2) file

New York State Department of Environmental Conservation

Building 40 - SUNY, Stony Brook, New York 11790-2356

Division of Environmental Remediation

Telephone: (516) 444-0240 Facsimile: (516) 444-0373

MR 1 3 797 John



Certified Mail/R.R.R.

March 10, 1997

David J. Keil, Project Manager Camp Dresser & McKee 100 Crossways Park West Woodbury, New York 11797

Re: Revised Investigative Work Plan for 25 Melville Park Road, Melville, NY

February 1997

Dear Mr. Keil:

Thank you for the submission of the revised Investigative Work Plan for the 25 Melville Park Road site. This work plan has satisfactorily addressed the Department's comments. This work plan will be officially approved after the following:

- 1. You identify the analytical laboratory that you intend to use for this project. This laboratory must be certified by NYSDOH ELAP for CLP category.
- 2. The Voluntary Investigation Agreement is signed by the volunteer and executed by the Department.

Please contact me prior to scheduling the field work. Please allow me sufficient notice so that I can order and receive the bottles for the Department's split samples.

Sincerely,

Robert R. Stewart

Environmental Engineer I

- R. Becherer cc:
 - J. Swartwout
 - R. Cozzy
 - J. Byrne
 - A. Chakraborti
 - G. Fitzpatrick, SCDHS G. Laccetti, NYSDOH

 - S. O'Hara, Archon Group S. Backer, Archon Group

 - C. McKenzie, Beveridge & Diamond

CDM Camp Dresser & McKee

environmental services 100 Crossways Park West Woodbury, New York 11797 Tel: 516 496-8400 Fax: 516 496-8864

February 27, 1997

Mr. Robert Stewart
Environmental Engineer
New York State Department of Environmental Conservation
Building 40 - SUNY
Stony Brook, NY 11790-2356

Subject: Submittal of Final Investigative Work Plan for

25 Melville Park Road, Melville, New York

Dear Mr. Stewart:

Enclosed please find copies of the final Investigative Work Plan for Voluntary Clean Up at 25 Melville Park Road. This work plan addresses comments from your department and those of the Suffolk County Department of Health Services (SCDHS) and the New York State Department of Health (NYSDOH).

As you requested, we have attached the resume of CDM's proposed Quality Assurance Officer, Mr. Drew Bennett. Mr. Bennett currently serves as CDM's Quality Assurance officer for all work performed under the New York State Department of Environmental Conservation (NYSDEC) Standby Contract. We trust he will meet with your satisfaction.

CDM looks forward to working with NYSDEC for the successful completion of this project.

Very truly yours,

CAMP DRESSER & McKEE

Daivd J. Keil, PG Project Manager

. roject manage.

S. O'Hara/Archon

C. McKenzie/B&D

G. Hayes/Archon

C. Velsor/CDM

R. Becherer/NYSDEP

G. Anders Carlson/NYSDOH

J. Byrne/NYSDEC

File: 2.1.1

(Gb2/stewart)

Work Plan For Voluntary Investigation

25 Melville Park Road Melville, New York

February 1997

Prepared for:

WHCS Real Estate Limited Partnership

600 E. Las Colinas Boulevard, Suite 1900 Irving, Texas 75039

Prepared by:

CDM Camp Dresser & McKee 100 Crossways Park Drive West Woodbury, New York 11797-2012

Contents

Letter of Transmittal

List of Tables

List of Figures

Section 1	Purpose and Scope 1-
	1.1 Introduction1-11.2 Site Description1-11.3 Site Geology and Hydrogeology1-3
Section 2	Previous Site investigations 2-1
	2.1Investigation Prior to 19962-12.2Site Investigation of 19962-22.3Previous Off-Site Investigations2-8
Section 3	Present Knowledge of Nature, Degree and Extent of Contamination 3-1
	3.1 Soils 3-1 3.2 Groundwater 3-1 3.3 Offsite 3-2 3.4 Source Area 3-2
Section 4	Investigative Work Plan4-1
Section 5	Schedule

List of Figures

Figure	
1	Site Location
, 2	Site Plan
3	TVOC Plume 2-4
4	Locations of Proposed Borings and Wells

List of Tables

Table		,	
1	Sample Parameters		-8

Section 1 Purpose and Scope

1.1 Introduction

Camp Dresser & McKee (CDM) has prepared this Remedial Investigation Work Plan for Voluntary Investigation for WHCS for the commercial property located at 25 Melville Park Road, Melville, New York. This work plan provides a scope of services to complete the remedial investigation in accordance with New York State Department of Environmental Conservation's (NYSDEC) Voluntary Cleanup Program. It is noted that WHCS is a secured lender to Delco Development Company, the current site owner, and the subject property is in receivership. WHCS has had no past history with this property or the former operations conducted there. WHCS is voluntarily pursuing the expeditious remediation of on-site source areas to meet criteria that will be acceptable to WHCS and the NYSDEC and to restore the property to a viable commercial use. The purpose of this remedial investigative work plan is to outline the method by which additional data will be obtained in order to more fully characterize the site and determine reasonable remedial actions. Specifically, information from soil borings, groundwater samples and soil samples will be used to further evaluate the nature and extent of impacted soils and groundwater on site. This plan has been developed to address NYSDEC comments on prior remedial investigations. CDM has reviewed pertinent information from previous investigations and incorporated relevant information into this plan. Data collected during prior investigations include results from monitoring well sampling, geoprobe and soil sampling, soil gas survey, ground penetrating radar results, and boring logs. The information is contained in the following reports:


- Phase I Environmental Site Assessment (AquaTerra, March 1993)
- Phase I Environmental Site Assessment with Subsurface Investigation (Fugro East, 1995)
- Additional Subsurface Investigation and Ground Penetrating Radar letter report (Fugro East 1995)
- Petrex Soil Gas Survey Report (NERI, Rizzo Assoc. 1995)
- Preliminary Remedial Action Plan (ERI, 1996)
- Work Plan for Voluntary Cleanup Action (ERI, 1996)

Where appropriate, background information has been directly incorporated from the Workplan for Voluntary Cleanup Action, prepared by ERI in August 1996.

1.2 Site Description

The subject property is located in the Village of Melville, Nassau County, Long Island, New York (figure 1). Route 495 (the Long Island Expressway) is located an estimated 1,000 feet north of the property. Surrounding properties are classified as industrial and commercial.

Presently, the property is occupied by a two-story office building and parking facilities. As of January 1996, building occupants included Northville Industries Corporation, Great Eastern Management, Inc. and Gilmore and Security Company, Inc. The building is served by municipal water and is heated by natural gas. The property is served by two on-site septic systems located to the south of the building. The nearest water supply well was identified approximately one-half mile

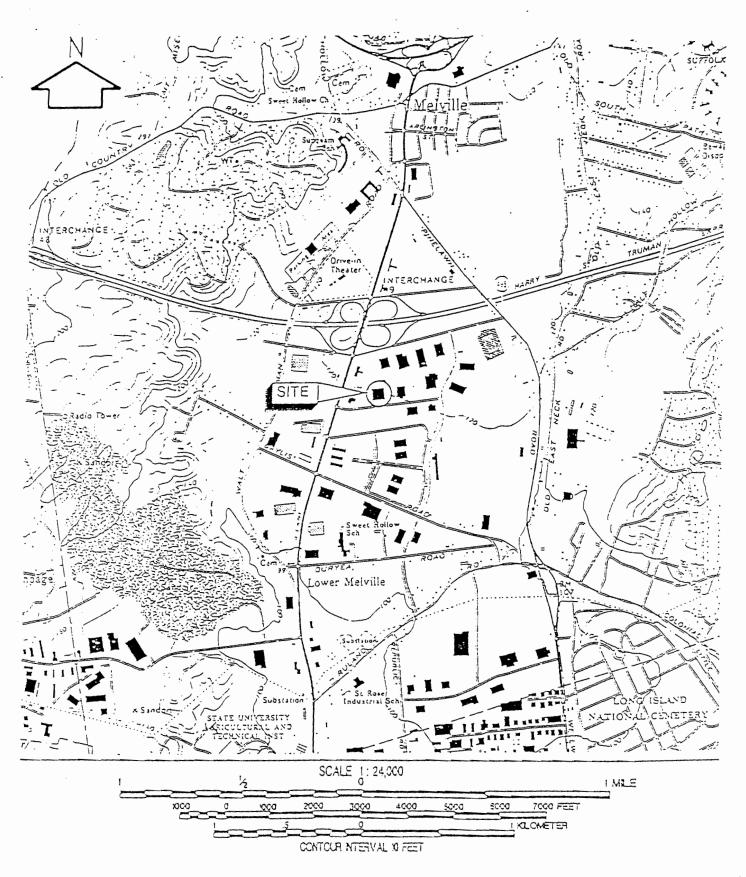

SOURCE: Fugro.

Figure 1 Site Location 25 Melville Park Road, Melville, New York

north of the site. Two additional wells are located an estimated one mile south-southwest of the site. The property is located within the South Huntington Water District.

Historically, the property was occupied by the New York Twist Drill Company (NYTD). NYTD was present on-site from 1966 (when the building was originally constructed) through 1985. NYTD apparently manufactured high-speed carbon and carbide drills. After NYTD vacated the building, the building was converted into a two-story office building. This renovation involved expanding the building footprint to the southeast (Figure 2).


According to the Article 12 Tank Registry (No. 4-02614) maintained by the Suffolk County Department of Health Services (SCDHS), NYTD operated four underground storage tanks (USTs) on the property. Two 2,500 gallon industrial waste USTs were abandoned near the northeast corner of the building in 1991. Representatives of the SCDHS were onsite during the tank abandonment and approved of the procedures. Reportedly, a smaller (200 gallon) industrial waste UST was also removed east of the building near the northern corner. This UST may have been associated with a former industrial septic system. Records confirming the removal of this tank were not found during a previous review. Soil borings conducted in the area however, encountered no tank. A fourth tank, a 10,000 gallon #2 fuel oil storage tank was reportedly removed in 1991 also. However, a geophysical/magnetometer survey conducted by a former consultant, Fugro, in January 1995 identified two anomalies. One anomaly was interpreted to be the 10,000 gallon fuel oil UST; the second, the two abandoned 2,500 gallon industrial waste UST's. The presence of an anomaly at the location corresponding to the former 10,000 gallon fuel oil UST, suggests perhaps that this tank was actually abandoned rather than removed. Evaluation of a NYTD floorplan included a hand drawn sketch which identified a floor drain leading to another waste oil UST. This UST was removed circa 1993 with its location indicated by an asphalt patch near the southeastern corner of the building. Previous reports have also identified a former "discharge or diffusion well" located near the north side of the entrance to the east loading dock. Reportedly, the use of the "diffusion well" was discontinued around 1981. The diffusion well was reportedly used for disposal of non-contact cooling water.

1.3 Site Geology and Hydrogeology

The site is underlain by thick, unconsolidated deposits of clay, silt, sand, and gravel that rest on a southward dipping crystalline bedrock. The deeper units were deposited during the Cretaceous Period (63-138 million years ago), and form (in ascending order) the Raritan and Magothy Formations. During the Tertiary Period (2 to 63 million years ago), any additional deposits overlying the Magothy Formation were eventually eroded away by glacial activity. During the Pleistocene Epoch (1.8 million years ago to 10,000 years ago), glacial melt water deposited outwash material forming what is presently known as the Upper Glacial aquifer.

Bedrock beneath the site is found at an approximate elevation of 800 feet below mean sea level (msl). The Lloyd aquifer overlies bedrock, and has a surface elevation of approximately 600 below msl. The Lloyd aquifer is a source of water for some south shore communities and consists of moderate to high permeability sands.

The Raritan clay is a major clay unit separating the Magothy aquifer from the Lloyd aquifer. Beneath the site, it is found between 400 and 600 feet below msl.

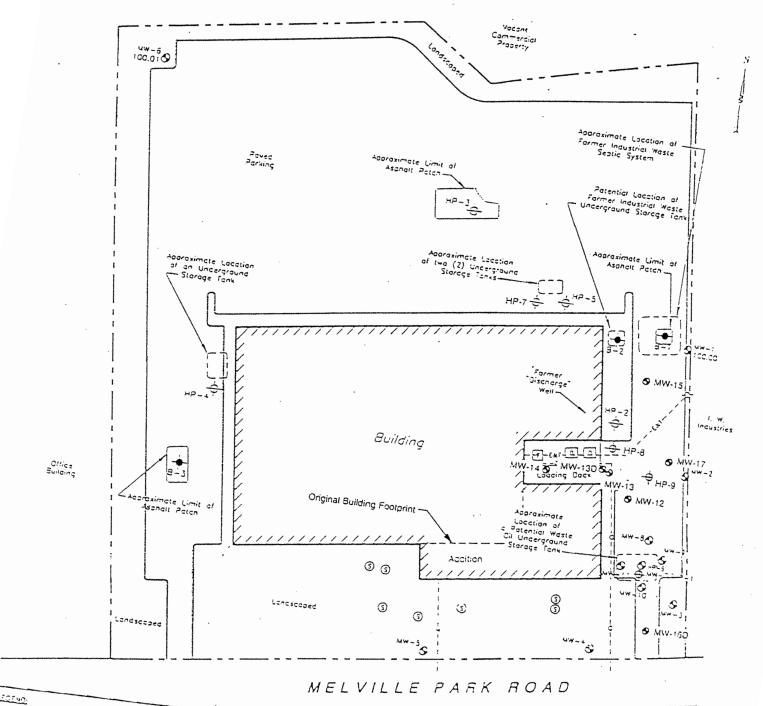

FEGENO:	MELVILI	LE PARK RO	DAD
Site Bauncary Undergraund Water Line Undergraund Natural Gas Line Undergraund Sleetric & Telephane Line	(3) c		Generei Instrument
SCALE: 1'=80'	Flening .	- Mydraffunch Faine Sail Baring	NOTE: All locations and elimensions are degraphines:
			Squares. Fugos field reconnaissance. - Welville Assessart Nos.

SOURCE: Fugro.

Above the Raritan Clay, the Magothy aquifer (50 feet above to 400 feet below msl) forms the major water bearing unit, consisting of sand and gravel deposits with minor lenses of silt and clay throughout. The contact between the Upper Glacial aquifer and the Magothy aquifer occurs at approximately 50-100 feet above mean sea level at the site. The Upper Glacial aquifer corresponds to the saturated upper part of the highly permeable Pleistocene deposit of sand and gravel, and is a major source of water supply in Suffolk County.

A review of local well logs (provided by the Suffolk County Department of Health Services) indicates that the overburden geology in the site area consists mostly of brown to gray fine to coarse sand with thin interbeds of clay. Solid gray clay was encountered at 293 feet below grade (fbg) in a well drilled south of Melville Park Road.

Section 2 Previous Site Investigations

2.1 Investigations Prior to 1996

Several previous environmental investigations have been performed on the subject site. These include:

- A Phase I Environmental Site Assessment performed by Aqua Terra dated March 1993;
- A Phase I Environmental Site Assessment with Subsurface Investigation performed by Fugro East, Inc. dated January 1995;
- An Additional Subsurface Investigation and Ground Penetrating Radar Letter Report by Fugro East dated January 1995;
- Findings of the Petrex Soil Gas Survey Report by Northeast Research Institute and Rizzo Associates dated November 1995.

Investigations by Fugro East

Fugro East ("Fugro") performed a preliminary geophysical (ground penetrating radar/magnetometer) survey in January 1995 and identified two magnetic anomalies. One of the anomalies was interpreted as a 10,000 gallon fuel oil UST located on the northwestern side of the building. The second anomaly was interpreted as the two abandoned 2,500 gallon industrial waste USTs. A second Ground Penetrating Radar Survey confirmed these subsurface anomalies.

A hydropunch and well boring survey was conducted in December 1994 by Fugro. Six hydropunch well points and three borings were advanced on the property. In addition, six existing wells were identified on the property. Several soil samples were analyzed for total petroleum hydrocarbons (TPH) via gas chromatograph/flame ionization detector (GC/FID), 13 priority pollutant metals, cyanide and pH. Ten groundwater samples were analyzed for volatile organic compounds (VOCs) via Method 8260 and TPH via GC/FID. Seven of the samples were also analyzed for dissolved priority pollutant metals, cyanide, and pH.

One soil sample extracted from boring B-2 had a concentration of mercury [1.8 milligrams per kilograms (mg/kg)] which exceeds NYSDEC recommended cleanup levels for soil. Boring B-2 was located in the former industrial UST area west of the former industrial septic system located near the northeastern corner of the building (see Figure 2). The soil sampling depth was unclear from the existing information.

The groundwater analytical results indicated that the area near the former waste oil UST (southeastern corner of the building) was contaminated with trichloroethene (TCE) and tetrachloroethylene (PCE). One groundwater sample (HP-2) had PCE and TCE levels of 15,000 and 1,100 ug/L, respectively. Groundwater beneath the property was encountered between 49 and 50 feet below grade. Fugro estimated the groundwater flow direction to be towards the south/southeast.

Follow-up soil and groundwater sampling was conducted by Fugro in January 1995. One additional hydropunch sample and one monitoring well were advanced. In addition, three borings were drilled. All of this additional sampling was conducted in the area of the former waste oil UST (where the elevated PCE and TCE levels were detected). Eleven soil samples were submitted for laboratory analysis and analyzed for TPH and VOCs via GC/FID and Method 8260, respectively. The soil sample depths ranged from 5 to 50 feet below grade. No VOCs or TPH levels were detected in the soil samples.

Fugro submitted three additional groundwater samples for analyses. One hydropunch point (HP-6) was advanced to 73 feet below grade. The analytical results indicated that higher levels of VOCs were detected near the water table (12,600 ug/L PCE) as compared to the deeper portion of the aquifer (7,300 ug/L PCE).

Four additional groundwater monitoring wells (MW-8 through MW-11) were installed by Fugro near the former waste oil UST in May 1995. Groundwater samples collected from these wells were analyzed for VOCs via Method 8260. The highest VOC values (TCE equaling 12,900 ug/L and PCE equaling 31,700 ug/L) were detected approximately 30 feet north of the former waste oil UST in well MW-8.

Investigation by Northeast Research Institute and Rizzo Associates

A soil gas survey was conducted on the property by Northeast Research Institute and Rizzo Associates in November 1995. Thirty seven shallow soil gas sampling points were installed on the east side of the building. The results of this survey showed that the highest reading for PCE was near the loading dock. The highest reading for TCE was detected just north of well MW-8.

The sum of the previous investigations indicated that the source of the PCE and TCE groundwater contamination is located north of the former waste oil UST and south of the former septic system. The results of the soil gas survey suggested that the loading dock area may be the source of the PCE groundwater contamination.

2.2 Site Investigation of 1996

Subsurface Investigation Conducted by ERI February-March 1996

All onsite investigative work during 1996 was performed by a previous consultant, Environmental Remediation, Inc. (ERI) of East Hartford, CT. ERI advanced four soil borings in the area of the former industrial septic system and the associated former 200 gallon UST (see Figure 2). Selected soil samples were collected at various depth intervals and analyzed for VOCs via Method 8260, TPH via GC/FID (extractables) and for Resource Conservation and Recovery Act (RCRA) Metals. The goal of this portion of the study was to delineate the mercury contamination detected in boring B-2 and to evaluate if any VOC contamination exists near the former industrial waste septic system.

Four additional groundwater wells were installed by ERI north of MW-8 to evaluate the loading dock, the former discharge well area and the area north of MW-8 as a possible source of the VOC contamination. In addition, a second goal of this groundwater study was to define the horizontal extent of the VOC contamination. Groundwater samples were collected from the monitoring wells and analyzed for VOCs via Method 8260.

In addition to the groundwater samples, selected soil samples from the four newly installed monitoring wells were also submitted for laboratory analysis. Although no VOCs were detected in soil samples collected during previous sampling events in the area of high groundwater VOC contamination, these additional soil samples were collected to confirm the absence of soil VOC contamination. Seven soil samples from the monitoring well borings were submitted for the VOC analysis via Method 8260 and TPH via GC/FID (extractables). Due to insufficient sample volume (recovery), the sample collected from MW-13 (45-47 fbg) was only analyzed for VOCs. Results of the analysis are discussed below.

Subsurface Investigation Conducted by ERI July 1996

Two deep groundwater monitoring wells were installed by Environmental Remediation, Inc. to establish the vertical extent of the contamination. One well (MW-16D) was placed near the southern property border to monitor the deep groundwater and to evaluate whether contamination was moving off-site. A second well (MW-13D) was installed adjacent to MW-13 to evaluate the vertical extent of the groundwater contamination in the vicinity of the contamination source. The wells were extended to approximately 90 fbg.

One additional water table well (MW-17) was also installed near a potential source area identified in the eastern parking lot. A metal detector was used to identify the potential source. The monitoring well was installed directly downgradient of the detected anomaly.


Several additional hydropunch groundwater samples were collected. Two hydropunch points were advanced to approximately five feet below the water table in the vicinity of MW-13. The purpose of these wells was to evaluate the source area of the contamination surrounding MW-13. One hydropunch groundwater sample (HP-7) was collected north of the building and west of existing hydropunch point, HP-5, to evaluate the area downgradient of the second abandoned waste oil UST.

All of the samples collected were analyzed for halogenated VOCs via Method 8010. In addition, the groundwater sample collected from well MW-17 was analyzed for total RCRA metals.

Summary of Soil Boring and Monitoring Wells

ERI drilling activities were conducted February to March and July of 1996. Fifteen soil borings were advanced, seven of which were completed as groundwater monitoring wells (MWS 12, 13, 14, 15, 13D, 16D and 17). Three hydropunches were used to collect groundwater samples. Borings and monitoring wells were located as follows (See Figures 2 and 3):

- MW-12: Monitoring well MW-12 was installed to evaluate soil and groundwater conditions upgradient of an area of documented groundwater contamination MW-8, and in the area of elevated soil gas concentrations of PCE. MW-12 was screened above a clay layer, which was encountered at a depth of approximately 56.5 fbg. This clay layer was not encountered in any of the subsequent soil borings.
- MW-13: Monitoring well MW-13 was located just east of the east loading dock. The purpose of the well was to evaluate soil and groundwater conditions downgradient of a potential source of contamination, the former "discharge well," and in the area of elevated soil gas concentrations of PCE.

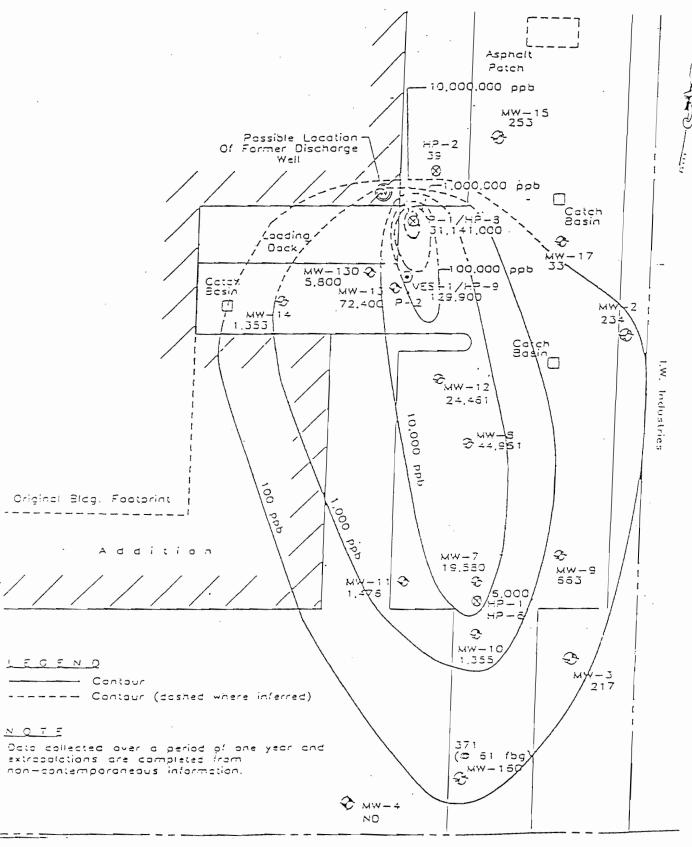

KEY:

• Monitoring Well

⊗ - Hydropunch

MAP SOURCE: ERI Preliminary Remedial Action Plan.

Figure 3 TVOC Plume 25 Melville Park Road, Melville, New York

- MW-14: Monitoring well MW-14 was installed immediately east of the loading dock. The purpose of the well was to evaluate soil and groundwater conditions in the vicinity of a potential release area, the loading dock.
- MW-15: Monitoring well MW-15 was installed east of the loading dock and the suspected location of the "discharge well". The purpose of this well was to evaluate soil and groundwater conditions associated with and potentially upgradient of the former discharge well.
- MW-13D: Monitoring well MW-13D was installed directly west of well MW-13 to evaluate the vertical extent of the soil and groundwater contamination in the vicinity of the contamination source.
- MW-16D: Monitoring well MW-16D was installed near the southern property border. The purpose of this well was to evaluate whether any contamination was moving off-site.
- MW-17: Monitoring well MW-17 was installed east of the loading dock and the suspected location of the "discharge well". The purpose of this well was to evaluate soil and groundwater conditions associated with a metallic anomaly identified in the east parking area.
- SB-7: Soil boring SB-7 was installed in the vicinity of the former industrial waste septic system leaching area. The purpose of the boring was to further delineate the extent of soil contaminated by mercury, and to evaluate the soil for the presence of VOCs. Refusal (possibly an old septic system pipe) was encountered at a depth of approximately 5.5 fbg, and the boring was abandoned.
- SB-7A: Soil boring SB-7A was installed adjacent to the abandoned boring SB-7 to collect samples below the depth of refusal which was encountered in boring SB-7. As with SB-7, the purpose of the boring was again to further delineate the extent of soil contamination by mercury, and to evaluate the soil for the presence of VOCs in the vicinity of the former industrial waste septic system leaching area.
- SB-8: Soil boring SB-8 was installed in the northern vicinity of the presumed former industrial waste septic system holding tank. The purpose of the boring was to further delineate the mercury contaminated soil, and to evaluate the soil for the presence of VOCs.
- SB-9: Soil boring SB-9 was installed in the vicinity of the presumed southern portion of the former industrial waste septic system holding tank. The purpose of the boring was to further delineate the mercury contaminated soil, and to evaluate the soil for the presence of VOCs.
- SB-10: Soil boring SB-10 was installed in the vicinity of the former industrial waste septic system. The purpose of the boring was to further delineate the extent of soil contamination and to evaluate the soil for the presence of VOCs.
- HP-7: Hydropunch Point HP-7 was advanced south of the western abandoned 2,500 gallon waste oil tank located north of the building and a groundwater sample was collected to evaluate the condition of the groundwater downgradient of this second tank.

- HP-8: Hydropunch Point HP-8 was advanced northeast of well MW-13. The purpose of collecting a groundwater sample from this location was to evaluate the source of the contamination.
- HP-9: Hydropunch Point HP-9 was advanced east of well MW-13. The purpose of collecting a groundwater sample from this location was to evaluate the source of the contamination.

The soil and groundwater investigation was performed using a truck mounted drill rig and the hollow stem auger (4.25 inch inside diameter) drilling technique. Split spoon samples were collected from the surface and at various depth intervals. In the deeper wells (MW-13D and MW-16D), clean water was added to keep the boring open below the water table. The samples were field screened both immediately after retrieval and by the head space method using an HNu-photoinization detector (PID) for VOCs.

Monitoring wells were constructed using two-inch diameter, flush-jointed polyvinyl chloride (PVC) well casing with a ten foot screen length of 10 slot PVC screen. The annular space surrounding each well screen was filled with Morie equivalent No. 2 inert silica filter gravel to an elevation two feet above the top of the screen. Above the sand, a two foot bentonite seal was placed to seal the well from the formation above. A concrete collar was poured around a flush-mounted, protective steel case to secure the wells.

Groundwater Elevation Surveys and Flow Direction Measurements

The monitoring wells were surveyed relative to an arbitrary datum, and water level measurements were collected at the time of the groundwater sampling on March 4, and on July 29, 1996 using an electronic air/water interface. The surveyed well elevations and water level data were then used to calculate the direction of groundwater flow. The direction of flow was calculated to be toward the south/southwest in the vicinity of the east loading dock on March 4 and towards the south/southeast on July 29, 1996. The groundwater gradient was calculated to be 0.001 during both measurement events. Based on the groundwater flow measurements and the distribution of contaminants over the site, it appears that the overall groundwater flow is towards the south/southeast.

Results of Soil Sampling and Analysis

February-March 1996

The four soil borings which were completed as monitoring wells in the vicinity of the loading dock and former discharge well were advanced to approximately 55-57 fbg. Each of the four borings performed in the vicinity of the former industrial waste septic system and tank were advanced to a depth of 20 fbg. The material encountered at the site generally consisted of light brown to light tan, fine to coarse sand and gravel deposits. A light, tan, coarse sand and gravel deposit was encountered in three of the four borings which were completed as monitoring wells, ranging from 48.5 fbg (MW-14) to approximately 55 fbg (MW-12, MW-13). A discontinuous medium gray clay unit was also observed at 56.5 fbg in MW-12.

Relatively elevated levels of VOCs were detected in the soil samples analyzed. Laboratory analysis of the monitoring well soil samples revealed the presence of PCE above the NYSDEC soil cleanup

objective of 1,400 micrograms per kilogram (ug/kg) in the sample collected from MW-13 at 54-54.7 fbg (30,000 (ug/kg)). TPH extractables representing diesel fuel, No.2 fuel oil and lubricating oil were also detected in the samples collected from MW-12 at 45-47 fbg and MW-13 at 54-54.7 fbg.

Samples collected from the soil borings in the vicinity of the former industrial waste septic system exhibited relatively low levels of contaminants. Constituents detected included TPH extractables resembling lubricating oil (21 mg/kg, SB-9 at 20-22 fbg), Nos. 4 and 6 heating oils (250 mg/kg, SB-10 at 05-07 fbg), and total metals including arsenic (0.5-2.5 mg/kg), barium (20-489 mg/kg), chromium (8 mg/kg), lead (0.5-2.1 mg/kg) and silver (2 mg/kg). Only barium exceeded the NYSDEC recommended cleanup objective of 300 mg/kg.

July 1996

Four soil samples were analyzed from the MW-13D soil boring. Boring MW-13D was extended to 90 fbg (40 feet below the water table). Soil samples collected from 45 fbg, 62 fbg, 67 fbg, and 75 to 77 fbg were submitted to laboratory analysis. PCE was detected in the 45 fbg sample (collected above water table) at 1,000 ug/kg. By comparison, PCE was detected in the 62 fbg sample at 200 ug/kg. No PCE was detected in either of the deeper samples.

Results of Groundwater Sampling and Analysis

February-March 1996

The four groundwater samples collected from monitoring wells MW-12, MW-13, MW-14, and MW-15 were analyzed for VOCs according to EPA method 8260. VOCs were detected in all four groundwater samples, ranging from 254 ug/L total VOCs (MW-15) to 72,400 ug/L total VOCs (MW-13). PCE was detected in all four samples above the NYSDEC water quality standard of 5 ug/L, at 17,000 ug/L in MW-12; 59,000 ug/L in MW-13; 360 ug/L in MW-14 and 150 ug/L in MW-15. Additional constituents detected in all four samples above the water quality standards included TCE (63 to 7,600 ug/L), 1,1,1-trichloroethane (TCA) (13 to 1,300 ug/L), and cis-1,2-dichloroethene (13 to 4,500 ug/L). The sample collected from MW-12 contained additional constituents above NYSDEC standards including 1,1-dichloroethene (30 ug/L), trans-1,2-dichloroethene (15 ug/L), ethyl benzene (22 ug/L), toluene (16 ug/L), 1,2,4-trimethylbenzene (76 ug/L), 1,3,5-trimethylbenzene (35 ug/L), Oxylene (110 ug/L) and P, M-xylene (120 ug/L). In addition, 1,1-dichloroethene (14 ug/L) and trans-1,2-dichloroethene (5 ug/L) were detected equal to or above the standard in the sample collected from MW-15 and MW-14, respectively.

July 1996

Hydropunch groundwater samples were collected from selected monitoring wells at various depth intervals (61, 76 and 86 fbg) from well MW-16D. Well MW-16D is located near the southern property boundary. The 61 fbg groundwater sample (collected near the water table) had a concentration of 300 ug/L PCE. The 76 fbg groundwater sample had a concentration of 9,800 ug/L PCE detected. The deepest groundwater sample (collected at 86 fbg) had a level of 2,600 ug/L PCE detected.

In addition to the hydropunch samples collected near the property border, two hydropunch groundwater samples (HP-8 and HP-9) were collected near the suspected source of the contamination (see Figure 3). PCE was detected in HP-8 in concentrations of 30,500,000 ug/L. In HP-9, PCE was detected at 122,100 ug/L. Trichloroethane (TCA) and TCE were also detected in

these two hydropunch groundwater samples. TCA was detected as high as 142,700 ug/L (HP-8) and TCE as high as 498,300 ug/L (HP-8).

One hydropunch groundwater sample (HP-7) was collected north of the building and downgradient of the second abandoned waste oil UST. PCE was detected in concentrations of 16 ug/L.

To supplement the hydropunch groundwater samples, three groundwater samples were collected from the two deep monitoring wells (MW-13D and MW-16D) and one water table well MW-17 located in the eastern parking lot. PCE was detected in the MW-13D groundwater sample at a level of 5,800 ug/L. In MW-16D, (near the southern property border), PCE was detected at 1,200 ug/L. The PCE concentration in MW-17 was 21 ug/L. In addition, relatively low levels of arsenic, barium, chromium and lead were detected in an unfiltered groundwater sample collected from MW-17.

2.3 Previous Off-Site Investigations

A previous assessment performed on the subject site in 1993 by Aciduria Environmental Services (AES) Corporation, indicated that the I.W. Industries property, located directly to the east of the subject site, is classified as a Class 2 inactive hazardous waste disposal site by the NYSDEC. The site assessment indicated that, based on its classification, the I.W. Industries site presents a significant threat to public health or the environment, and that remedial action is required.

This previous assessment indicated that the State Pollution Discharge Elimination System (SPDES) permit was prepared for and groundwater sampling was conducted on the I.W. Industries site. Contaminants detected in a former SPDES outfall above the maximum allowed levels included metals (copper, iron, aluminum, lead and zinc), 1,2,4 trimethylbenzene, 1,3,5 trimethylbenzene, 1,2,4,5 tetramethylbenzene and xylenes. Contaminants detected in groundwater included cis-1,2-dichloroethene, lead, and benzene. According to the AES report, the discharge ceased in September 1984, coincident with the removal of two industrial waste pools (pumped and backfilled with clean fill), and the capping of the filtration system in the area. According to the report, a remedial investigation/feasibility study (RI/FS) had not been completed for the property.

Section 3 Present Knowledge of Nature, Degree and Extent of Contamination

The information collected during previous investigations was used to evaluate the nature, degree and extent of the contamination. This information, combined with data obtained from the proposed remedial investigation, will be used in the future to develop a remedial action plan.

3.1 Soils

Based upon the available data, soils under the subject site appear to have been impacted by VOCs in the vicinity of the east loading dock. PCE was detected in the soil above the NYSDEC cleanup level in the soil boring for MW-13 at 54-54.7 fbg (33,000 ug/kg). PCE was detected in the samples collected from MW-12 (45-47 fbg), MW-13 (45-47 fbg) at 180 ug/kg and MW-13D (45 fbg) at 1,000 ug/kg. Wells MW-13 and MW-13D are located east of the loading dock area. The surrounding monitoring wells (MW-14, MW-15 and MW-8) did not have any VOCs detected in the soil samples. It appears that the source of the soil VOC contamination is near well MW-13. In addition, based on the levels detected in the groundwater samples, the extent of the soil contamination appears to include HP-8 and HP-9. Further investigation is required to determine the vertical extent of the plume in the vicinity of HP-8. However, additional investigation in the area of the loading docks will need to be performed to determine the horizontal extent of soil contamination.

3.2 Groundwater

In general, PCE, TCE and TCA were detected in the highest concentrations near well MW-13, HP-8 and HP-9. Of these sampling points, HP-8 exhibited the highest levels of contamination. PCE levels were three orders of magnitude higher than those detected in MW-13 and HP-9 and two orders of magnitude higher in levels of TCA and TCE. PCE was detected above the solubility limits (in HP-8) and likely occurs as a free phase in the vicinity of HP-8. The HP-2 hydropunch groundwater sample was collected directly northeast of and upgradient of HP-8. PCE was detected at 28 ug/L. Total VOC concentration appears to decrease from the suspected source area downgradient to the property boundary.

The horizontal extent of the PCE contamination and other VOC compounds extends south of the HP-8, HP-9 and MW-13 area to the property boundary. The total VOC concentration appears to decrease from the suspected source area downgradient to the property boundary. The concentrations detected at the water table decrease to 300 ug/L in the MW-16D (61 fbg) groundwater sample. MW-16D is located near the southern property boundary. The eastern extent of the contamination appears to be coincident with the property border. Samples collected from wells MW-2 and MW-3 (near the eastern property border) had relatively low levels of PCE detected (120 and 110 ug/L, respectively).

The vertical extent of the groundwater contamination was evaluated near the source area. The deep groundwater sample collected from MW-13D had PCE concentrations of 5,800 ug/L compared to a concentration of 59,000 ug/L in MW-13.

The hydropunch groundwater sample collected from 76 fbg (MW-16D) had levels of 9,800 ug/L PCE detected. By comparison, the hydropunch samples collected near the water table surface (61 fbg) and at a deeper depth (86 fbg) had relatively lower levels detected equaling 300 and 2,600 ug/L, respectively. The sample collected from the permanent monitoring well MW-16D (screened from 80 to 90 fbg) had levels of 1,200 ug/L detected. Overall, it appears that the highest levels of PCE contamination were detected near the presumed source area at a depth of 85 fbg and downgradient of the presumed source area, decreasing towards the southern property boundary.

3.3 Offsite

Based upon information from previous investigations, soil and groundwater contamination exists at the southern property boundary of the site. This suggests a potential for offsite plume migration. Under the stipulations and provisions of NYSDEC's voluntary cleanup program, only on-site contamination will be addressed. As stated in a September 25, 1996 correspondence from NYSDEC, the goal of the voluntary cleanup will be to remediate the on-site soil and groundwater contamination. Groundwater contamination extends offsite. However, study and remediation of this offsite contamination will not be required under the voluntary cleanup program. The Department will attempt to have previous owners/operators fund the offsite investigation and remediation.

NYSDEC reserves the right to evaluate offsite/downgradient properties for the presence/absence of site related contamination. The work plan tasks proposed herein serve only to quantify the nature, extent and degree of on-site contamination. To date, NYSDEC has not performed a formal evaluation of offsite/downgradient properties.

3.4 Source Area

The elevated levels of PCE, TCE and TCA detected in hydropunch groundwater sample HP-8 indicate that the source of the contamination is near the loading dock. An upgradient hydropunch groundwater sampling point (HP-2) shows a marked decrease in the levels of contaminants detected. Similarly, the detected level of contaminants decrease to the east (MW-17) and to the west (MW-13 and MW-14) of point HP-8. Based on the groundwater flow direction (south/southeast), it appears that the source of the PCE and other related solvent contamination is in the direct vicinity of HP-8.

Section 4 Investigative Work Plan

Additional Work Tasks

In order to complete the site investigation and fill in the data gaps identified on a September 25, 1996 correspondence from NYSDEC, CDM proposes to conduct additional investigations. A portion of the additional investigations will include a field study and/or sample collection and analyses, the results of which will be used to evaluate groundwater remedial technologies which can be pilot tested for full scale implementation. It is anticipated that any additional sampling and analysis will take place coincident with the field program identified in task 1.3.

Prior to the field study, CDM will undertake a review of the site history. This task will include several subtasks including:

- Data Review
- Review of SCDHS and NYSDEC files
- Interviews with former NYTD employees
- Contact NYSDEC for status of offsite investigations
- Evaluation of 1995 Ground Penetrating Radar (GPR) signatures
- Meeting with NYSDEC

Each subtask is briefly described below.

- Data Review. Although most of the historical sampling data has already been reviewed, CDM will reassess the analytical data to ensure that no data gaps will exist following completion of the proposed additional field activities. Should data gaps be identified, CDM will modify the field effort accordingly.
- Review project files retained by the Suffolk County Department of Health Services (SCDHS) and the New York State Department of Environmental Conservation (NYSDEC). Data collected from SCDHS has proven to be useful in focusing the field effort. SCDHS records were used to identify the possible source area(s)as they indicated the presence of an UST, a drum storage area and an underground waste oil transfer line presumably used during the former NYTD operations, circa 1960's.
- Interviews with former NYTD employees. Performed in conjunction with the file reviews, the identification of former NYTD employees involved in property/facility maintenance will be reviewed. It has been CDM's experience that former employees often provide the crucial bit of information regarding disposal practices. Names of these individuals are often recorded on Health Department audit forms. Review of the available data suggests that SCDHS did conduct frequent audits of the former NYTD facility.
- Status of offsite investigations. CDM will contact NYSDEC to determine what actions have been taken to evaluate the extent of offsite downgradient contamination. The objective of this exercise is to determine the extent of PCE contamination offsite to the 5 ppb level, pursuant to the NYSDEC's voiced concern of October 11, 1996, to the extent such information is available.

- In accordance with NYSDEC's request, CDM will make attempts to contact the contractor who performed the original ground penetration radar study on the east side of the premises. Anomalies in the GPR record will be re-evaluated by the Contractor with the intent to determine whether the anomalies are actual buried targets worthy of additional investigation.
- Meeting with NYSDEC. Upon completion of the aforementioned tasks and the field program presented below, CDM will meet with NYSDEC to discuss the results of the investigation, provide details of a potential pilot groundwater and soil remediation technology, present plans for full scale implementation, and determine a basis for site closure, including issuance of a "no further action" letter.

Additional Field Study

Task 1: Additional Field Study

NYSDEC identified a number of data gaps in the results of previous site investigations. To date, the investigation has not fully delineated the extent of contamination. Limited investigation is necessary to develop and pilot test the selected remediation alternatives. The proposed additional investigations are outlined below. Locations of proposed soil borings and monitoring wells are depicted in figure 4. It is noted that all field investigative procedures and environmental sampling protocols will be conducted in accordance with the NYSDEC guidelines maintained under the State's Environmental Standby Contract. NYSDEC will be notified of any deviations to these guidelines as a result of site specific field conditions.


In addition all field work will be governed by the CDM Site Specific Health and Safety Plan (attached) to ensure that on-site workers are adequately protected. Potential exposures to building tenants and to on-site workers will be through temporary access restrictions. Potential exposures to the surrounding community will follow the protocol outlined in the New York State Department of Health (NYSDOH) Community Air Monitoring Plan.

1.1 Source Areas

The approximate location of the suspected source for the TCE/PCE plume has been identified through the high concentrations found in monitoring well MW-13 (72,400 ppb TVOC), and the presence of Dense Non-Aqueous Phase Liquids (DNAPL) near the hydropunch sample HP-8. These results, coupled with the lower concentrations in hydropunch sample HP-2, and lower concentrations found in monitoring wells MW-13, 14 and 17, suggest that the source of DNAPLs originated near the loading dock. The ground penetrating radar study performed in January, 1995 (Fugro East 1995) covered the entire eastern side of the building, and found no evidence of underground storage tanks. Unfortunately, the prior investigation was limited in extent and did not characterize a remaining potential source area: the area beneath the loading dock/dumpster area.

Copies of site plans of the former NYTD facility provided by WHCS contain handwritten sketches of a former drum storage area and/or underground tank location. This former storage area corresponds with the location of the present loading dock and dumpster area. Ground penetrating radar and magnetometer techniques will be used to characterize this area. In areas where the present building overlies an area formerly designated as a drum storage or UST area, a GPR investigation will be attempted. This phase of the geophysical investigation will be performed in the southeast portion of the building interior. Should the GPR and/or magnetic survey detect a potential



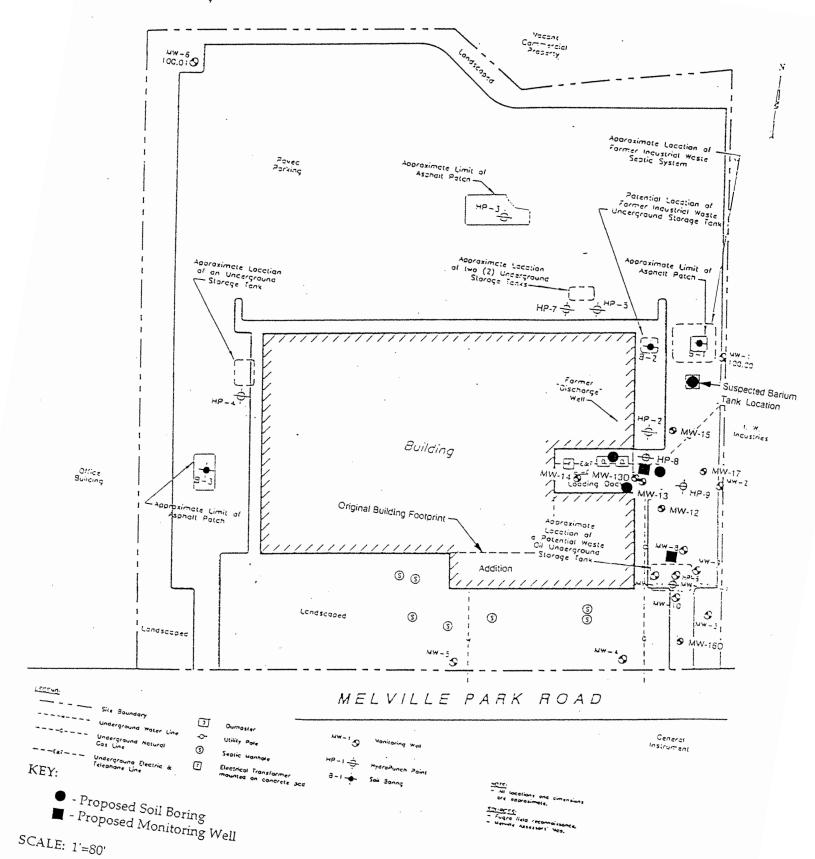

SOURCE: Fugro.

contaminant source (i.e., buried tank), the proposed remedial alternative will be designed to address not only the loading dock/dumpster area but also the area beneath the present building footprint.

Three soil borings will be made in the loading dock/dumpster area to further delineate the extent of the suspected DNAPL source. If a previously unknown tank is discovered in the loading dock/dumpster area, at least one of the borings will be advanced adjacent to the tank. The borings will be extended to the depth of the water table, with samples taken every ten feet (a total of 5 samples each). All samples will be screened with an Hnu photoionization detector immediately after retrieval at each borehole. Heated head space analysis using the Hnu will also be performed, along with the use of hydrophobic dye to help identify DNAPL contaminated soils. The samples with the two highest readings per boring will be sent to the laboratory for VOC analysis.

One of the three soil boring locations will be converted to a deep groundwater monitoring well (see Section 2.3 for vertical plume delineation). If a tank is discovered during the GPR study, the boring next to the tank will be converted to the monitoring well. A groundwater sample will be taken at the water table and analyzed for VOCs. It is noted that any groundwater sample collected at the water table from a temporary well will be collected from an interval minimum of 4 feet into the water table.

Historical data indicate that one groundwater sample from MW-17 contained barium at a concentration in excess of NYSDEC recommended cleanup levels (1.7 mg/L versus 1.0 mg/L). The former groundwater sample was turbid which could result in false positive results or elevated results, not representative of actual groundwater conditions. The potential source of barium was a waste underground storage tank reportedly located in the area of MW-17. That location corresponds with an asphalt patch in the eastern parking area. The former GPR survey conducted in that area did not identify an anomaly, which suggests that the tank was removed. CDM proposes that no additional subsurface investigation be conducted for the former barium waste tank. Task 1.3, however, presents CDM's proposal to conduct a comprehensive groundwater sampling event at existing onsite monitoring wells. Groundwater will be analyzed for barium (among other constituents). Should barium be detected in these samples at levels which exceed NYSDEC guidance values, then CDM will conduct additional investigations (soil boring(s) and sampling) in the presumed barium source area.

A review of the historical environmental data by NYSDEC has shown that one of the key samples had been improperly handled. As such, data from this sample has been deemed as unusable. CDM will make efforts to duplicate the sample by collecting a single split spoon sample adjacent to MW-11 at the 10-12 foot interval. Analysis of this soil sample will be for total volatiles NYSDEC ASP Method 91-1.

During the course of the additional field study, waste material will be generated. Any residuals from the soil borings (soil, water) will be drummed and stored onsite until completion of the investigation, at which time the materials will be characterized and disposed by a licensed contractor.

During the drilling of the soil borings, particular attention will be paid to the site geology. Lithology information collected to date indicates the presence of clay stringers, but no continuous clay layers.

1.2 Vertical Plume Definition

The distribution of contaminants as evaluated from previous investigations indicates that contamination has reached depths of over 90 feet below grade in the vicinity of the presumed source area (HP-8). CDM believes that this cannot be attributed solely to vertical downward groundwater gradients, and is a strong indication of DNAPL contamination at depth near the source area. In order to investigate the vertical extent of the plume, two new monitoring wells will be installed. One well will be installed just down gradient of HP-8; the second will be placed near the center of the plume adjacent to MW-8. At each location, a borehole will be drilled to 90 feet, where a groundwater sample will be taken. The borehole will be advanced to a depth of 135 feet, with split spoon samples collected every 5 feet. The split spoon samples will be important in identifying any confining units near the source area that may impact the vertical movement of the DNAPL. Groundwater samples will be taken in advance of the drill bit at 15 foot intervals between 90 and 135 feet. Samples will be sent to a laboratory for 24-hour turnaround for VOCs. Based on the groundwater sampling results, final well screen settings will be placed to correspond with the bottom of the plume. It is assumed that the bottom of the plume will be less than 135 feet and that each well will be approximately 125 feet deep, with a 4-inch diameter, PVC casing and screen. Note that if VOC contamination above 100 ppb is detected at a depth of 135 feet, drilling will continue another 30 feet, with samples sent out for 24 hour turnaround. Based on the results, drilling will continue in 30 foot intervals until a VOC concentration of less than 100 ppb is encountered or the practical limits of drill depth are achieved.

In order to close an apparent data gap identified by NYSDEC, four (4) additional water samples will be collected from these two boreholes with the use of temporary wells. Samples will be collected from the intervals of 64 and 72 feet below grade. Samples will be analyzed for chlorinated solvents (VOCs) only.

For all intrusive activities described in task 1.1 and 1.2, R&L Drilling of Islip, New York will provide drilling services. Geophysical surveys will be performed by NAEVA Geophysics of Tappan, New York.

1.3 Comprehensive Sampling of Existing Wells

Although considerable data exists from the prior investigations, a number of inconsistencies in sampling protocol and selected analytical procedures have been identified by the NYSDEC. In order to gain a complete picture of the site contamination and avoid returning for additional sampling after initial results are received, a single, synoptic round of groundwater samples is recommended from the following monitoring wells: MW-2, MW-3, MW-4, MW-7, MW-8, MW-9, MW-10, MW-11, MW-12, MW-13D, MW-14, MW-15, MW-16D, and MW-17. Samples will also be taken from the two new proposed wells, as well as from the existing onsite supply well (if available). Since no information is present on the construction method or depth of the former onsite supply well, CDM will attempt to sound the well and collect water level information and groundwater samples. The two new wells will be developed and will be allowed to stabilize for 14 days. After 14 days, all wells will be purged and groundwater samples will be collected when the turbidity is less than 50 N.T.U.

If during normal well purging efforts (pre-groundwater sample collection), the turbidity of the groundwater remains greater than 50 NTUs, CDM will perform one of the following:

- collect both an unfiltered and a filtered groundwater sample in order to determine the effect of turbidity in the metals analysis. CDM will conduct this testing on groundwater samples collected from MW-10, MW-13, MW-14, MW-15 and MW-17.
- decant clear water from a volume of groundwater which has been allowed to settle for a period of time estimated to be 2 hours. This decanting procedure will only be used for metals and semi-volatile analyses. Decanting will not be performed on samples earmarked for volatile organic analyses.

All groundwater samples will be tested for volatiles and semi-volatiles. In addition, sampling for trace metals (antimony, manganese, arsenic, beryllium, barium, cadmium, chromium, copper, iron, lead, mercury, nickel, selenium, silver, thallium, and zinc) as well as cyanide will be included. Should other analytes be required to obtain information on water chemistry and its impact or influence on potential remedial technologies, appropriate sampling will be conducted during the comprehensive sampling round.

Development/purge water from the sampling will be drummed and stored onsite for eventual disposal by a licensed contractor at an appropriate disposal facility.

1.4 Laboratory

All environmental samples will be collected and delivered to a NYSDEC approved laboratory with CLP certification. Analyses will include Target Compound List volatile organics and semi-volatile organics, as well as metals.

Field blank samples and trip blank samples will be taken at the appropriate frequencies (one each per day of sampling) to ensure proper quality assurance and quality control. In addition, duplicate samples will be collected at a frequency of one duplicate per ten samples (10%).

Although no data validation has been performed on any of the environmental data collected to date, it will be performed during this comprehensive sampling round. A NYSDEC standby contractor, ChemWorld Environmental of Rockville, MD, will provide CDM with data validation services. CDM's Quality Assurance Officer will determine the usability of all data following the data validation process.

Table 1 provides a matrix sheet of the proposed samples to be collected, media to be sampled, analytical methods, sample preservatives, sample containers and holding times.

Task 2: Report/Recommendations

Data obtained from prior investigations will be integrated with the data collected by CDM in a written report, which will provide the basis for an evaluation of the proposed remedial action, as well as aid in the eventual design of the necessary pilot studies. The data will be analyzed and appropriate conclusions drawn about the nature and extent of contamination at the site. CDM will submit a Draft Voluntary Investigation Report by incorporating the additional data and analysis from the field investigations. The report will be prepared for submission to the NYSDEC, and will conform to NYSDEC regulations and protocols. CDM will incorporate comments from two reviews of the Draft Voluntary Investigation Report, one by WHCS, and one by NYSDEC and appropriate agencies to which NYSDEC may circulate the draft document. It is anticipated that NYSDEC will

Sample Matrix	Parameter	Number Of Samples	Analytical Reference Method	Sample Preservation	Holding Time [a]	Container
Hydrogeologic Characterization Environmental Samples						
• Groundwater Monitoring Well Samples	VOAs	31	CLP [b]	Cool to 4 C	7 days	2 x 40-ml vial
	BNAs	19	CLP [c]	Cool to 4 C	5 days extractions 40 days analysis	5 days extractions 2 x 80-oz amber or 40 days analysis 4 x Hiter amber
	Metals	19	CLP [d]	HNO3 to pH<2 Cool to 4 C	6 months/ Hg-26 days	1 liter poly
	Cyanide	19	CLP [d]	NaOH to pH<12 Cool to 4 C	12 days	1 liter poly
Sediment Samples	VOAs	7	CLP [b]	Cool to 4 C	7 days	2 x 40-ml vials
	BNAs	9	CLP [c]	Cool to 4 C	5 days extractions 40 days analysis	5 days extractions 1 x 8-02 glass jar 40 days analysis
	Metals/ Cyanide	9	CLP [d]	Cool to 4 C	6 months/ Hg-26 days	1 x 8-oz glassjar

- [a] Unless otherwise noted, all holding times are from Verified Time of Sample Receipt (VTSR) at the laboratory
- [b] Analysis will be performed in accordance with NYSDEC Analytical Services Protocol (ASP) 1991, Exhibit D, Part II (NYSDEC Method 91-1).
- [c] Analysis will be performed in accordance with NYSDEC ASP 1991, Volume 2, Exhibit D,
- Part III and IV (NYSDEC methods 91-2 and 91-3)

 [4] Analysis will be performed in accordance with NYSDEC ASP 1991, Volume 2, Exhibit D,

NOTES:

- 1. Sample parameter table does not include parameters which may be collected for pilot study purposes.

 2. All analytical results to undergo data validation.
- 3. Duplicates to be collected at a frequency of one duplicate per ten samples or 10%.
- 4. Field and trip blank samples to be collected at a frequency of once per day.
- 5. CLP requirements call for one MS/MSD duplicate per 20 samples. MS/MSD samples will be collected for groundwater and soil.

6. Quality control samples:

MS Samples: 4 GW; 3 Soil, MSD Samples: 4 GW; 3 Soil, TB Samples: 2, FB Samples: 4, EB Samples: 3.

coordinate and resolve any inconsistency among any Agency comments, and that CDM will be provided with one consolidated set of comments for incorporation into the final document. If necessary, based upon the number and extent of comments, an additional draft report will be circulated for review. Twelve (12) copies of the Draft Voluntary Investigation report, and 12 copies of the final document will be produced.

During the review process for the Draft Voluntary Investigation Report, CDM will outline recommended tasks to be performed as part of a Remedial Work Plan. It is expected that this document will outline specific tasks conducted to meet the recommended site cleanup objectives. These tasks include development of a pilot study protocol evaluation of pilot study results, followed by full scale implementation of the selected remedial alternatives.

Task 3: Contingencies (Optional)

Due to the very focused nature of the final phase of this field investigation and the significant schedule constraints, several unanticipated results may arise. Should this occur, CDM will, with WHCS approval, implement the following contingency plans.

In the unlikely event that the two proposed deep monitoring wells fail to delineate the vertical extent of the plume/DNAPL zone, drilling and groundwater sampling would continue. Potential future sampling actions will be contingent on new data and findings.

If, during the groundwater sampling event, either individual contaminant species or suites of contaminants are identified in areas where they have not been known to occur previously, CDM will utilize this data in the context of its groundwater modeling capability to project the limits of this contamination. The subsequent remedial design will encompass all impacted on-site areas.

In the event that barium is detected in groundwater at concentrations exceeding 0.7 parts per million, a soil boring will be installed adjacent to or beneath (by angle drilling) the former barium waste storage tank.

In the event that previously unknown, potential contaminant sources are identified as a result of the ground penetrating radar/magnetometer survey, CDM has the flexibility to expand the soil boring and soil sampling program into these areas in order to adequately characterize the suspected sources.

Under any conditions where an expansion or modification of the field program is warranted, NYSDEC will be contacted. Should an expansion or modification of the field program be recommended by NYSDEC, any necessary revisions will be made.


HEALTH AND SAFETY PLAN FORM

CDM Health and Safety Program

This document is for the exclusive use of CDM and its subcontractors

CAMP DRESSER & McKEE INC.
PROJECT DOCUMENT #;

THIS PAGE RESERVED FOR MAP (Show Exclusion, Contamination Reduction, and Support Zones. Indicate evacuation and reassembly points.)

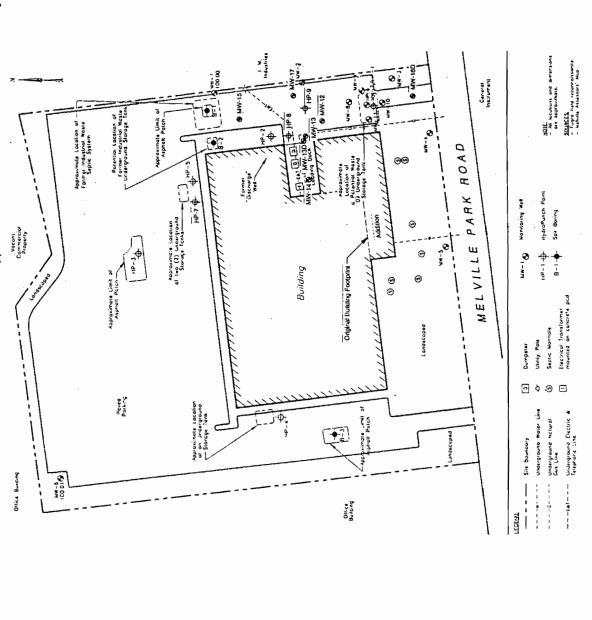

HEALTH AND SAFETY PLAN FORM This do CDM Health and Safety Program	This document is for the exclusive CAMP DRESSER & McKEE INC. use of CDM and its subcontractors PROJECT DOCUMENT #:
HISTORY: Summarize below. Include complaints from public, previous agency actions, known exposures or injuries, etc.	sy actions, known exposures or injuries, etc.
New York Twist Drill (NYTD) company originally constructed the facilequipment. NYTD operated the facility until 1985 when they vacated they was enlarged and converted into a two-story office complex. Regulator all have been abandoned or removed.	New York Twist Drill (NYTD) company originally constructed the facility in 1966 as the site for the manufacturing of high speed carbon and carbide drills and equipment. NYTD operated the facility until 1985 when they vacated the premises. The former manufacturing area was gutted and renovated. The present structure was enlarged and converted into a two-story office complex. Regulatory agency files document the presence of several UST's and a discharge well. Most if not all have been abandoned or removed.
WASTE TYPES: (x) Liquid () Solid () Sludge () Gas (() Unknown () Other specify:
WASTE CHARACTERISTICS: Check as many as applicable. () Corrosive () Flammable () Radioactive (x) Toxic (x) Volatile () Reactive () Inert Gas () Unknown (x) Other specify:	WORK ZONES: Describe the Exclusion, Contamination Reduction, and Support Zones in terms on-site personnel will recognize Exclusion zone will exist around each borehole and the drill rig. During well sampling, the exclusion zone will be around the well head only. Contaminant reduction and support zones will be established in an upwind direction. In accordance with NYSDOH requirements, VOC and dust monitoring will be conducted in down wind direction during intrusive work.
Chlorinated and non-chlorinated solvents mixed with petroleum based contaminants.	
HAZARDS OF CONCERN: (x) Heat Stress attach guidelines (x) Cold Stress attach guidelines (x) Cold Stress attach guidelines (x) Cold Stress attach guidelines (x) Organic Chemicals (x) Motorized Traffic (x) Madiological (x) Heavy Machinery (y) Biological (x) Slips, Trips, & Falls (y) Other - specify	It is not be believed that the present facility generates hazardous materials. The former NYTD operation disposed of spent material in underground holding tanks. Evidence suggests that discharge lagoons and a discharge well were also used for disposal. Former site plans also indicate an outdoor drum storage area.

Page 4 of 11

AFETY PLAN FORM	AFETY PLAN FORM	ND SAFETY PLAN FORM	ND SAFETY PLAN FORM	ND SAFETY PLAN FORM	ND SAFETY PLAN FORM	AND SAFETY PLAN FORM	AND SAFETY PLAN FORM	IEALTH AND SAFETY PLAN FORM	ND SAFETY PLAN FORM	UD SAFETY PLAN FORM	ND SAFETY PLAN FORM
AFETY PLAN FORM	AFETY PLAN FORM	ND SAFETY PLAN FORM	ND SAFETY PLAN FORM	ND SAFETY PLAN FORM	ND SAFETY PLAN FORM	AND SAFETY PLAN FORM	AND SAFETY PLAN FORM	AND SAFETY PLAN FORM	ND SAFETY PLAN FORM	UD SAFETY PLAN FORM	ND SAFETY PLAN FORM
AFETY PLAN FORM	AFETY PLAN FORM	ND SAFETY PLAN FORM	ND SAFETY PLAN FORM	ND SAFETY PLAN FORM	ND SAFETY PLAN FORM	AND SAFETY PLAN FORM	AND SAFETY PLAN FORM	AND SAFETY PLAN FORM	ND SAFETY PLAN FORM	UD SAFETY PLAN FORM	ND SAFETY PLAN FORM
AFETY PLAN FORM	AFETY PLAN FORN	ND SAFETY PLAN FORN	ND SAFETY PLAN FORN	ND SAFETY PLAN FORN	ND SAFETY PLAN FORM	AND SAFETY PLAN FORN	AND SAFETY PLAN FORN	AND SAFETY PLAN FORN	ND SAFETY PLAN FORN	UD SAFETY PLAN FORN	ND SAFETY PLAN FORN
AFETY PLAN FOR	AFETY PLAN FOR	ND SAFETY PLAN FOR	ND SAFETY PLAN FOR	ND SAFETY PLAN FOR	ND SAFETY PLAN FOR	AND SAFETY PLAN FOR	AND SAFETY PLAN FOR	AND SAFETY PLAN FOR	ND SAFETY PLAN FOR	JD SAFETY PLAN FOR	ND SAFETY PLAN FOR
AFETY PLAN FOR	AFETY PLAN FOR	ND SAFETY PLAN FOR	ND SAFETY PLAN FOR	ND SAFETY PLAN FOR	ND SAFETY PLAN FOR	AND SAFETY PLAN FOR	AND SAFETY PLAN FOR	AND SAFETY PLAN FOR	ND SAFETY PLAN FOR	VD SAFETY PLAN FOR	ND SAFETY PLAN FOR
AFETY PLAN FOR	AFETY PLAN FOF	ND SAFETY PLAN FOR	ND SAFETY PLAN FOR	ND SAFETY PLAN FOR	ND SAFETY PLAN FOR	AND SAFETY PLAN FOR	AND SAFETY PLAN FOR	AND SAFETY PLAN FOR	ND SAFETY PLAN FOR	UD SAFETY PLAN FOR	ND SAFETY PLAN FOR
AFETY PLAN FO	AFETY PLAN FO	ND SAFETY PLAN FO	ND SAFETY PLAN FO	ND SAFETY PLAN FO	ND SAFETY PLAN FO	AND SAFETY PLAN FO	AND SAFETY PLAN FO	AND SAFETY PLAN FO	ND SAFETY PLAN FO	VD SAFETY PLAN FO	ND SAFETY PLAN FO
AFETY PLAN FO	AFETY PLAN FO	ND SAFETY PLAN FO	ND SAFETY PLAN FO	ND SAFETY PLAN FO	ND SAFETY PLAN FO	AND SAFETY PLAN FO	AND SAFETY PLAN FO	AND SAFETY PLAN FO	ND SAFETY PLAN FO	VD SAFETY PLAN FO	ND SAFETY PLAN FO
AFETY PLAN F(AFETY PLAN FO	ND SAFETY PLAN FO	ND SAFETY PLAN FO	ND SAFETY PLAN FO	ND SAFETY PLAN FO	AND SAFETY PLAN FO	AND SAFETY PLAN FO	AND SAFETY PLAN FO	ND SAFETY PLAN FO	VD SAFETY PLAN FO	ND SAFETY PLAN FO
AFETY PLAN F	AFETY PLAN F	ND SAFETY PLAN F	ND SAFETY PLAN F	ND SAFETY PLAN F	ND SAFETY PLAN F	AND SAFETY PLAN F	AND SAFETY PLAN F	AND SAFETY PLAN F	ND SAFETY PLAN F	VD SAFETY PLAN F	ND SAFETY PLAN F
AFETY PLAN I	AFETY PLAN I	ND SAFETY PLAN I	ND SAFETY PLAN I	ND SAFETY PLAN I	ND SAFETY PLAN	AND SAFETY PLAN I	AND SAFETY PLAN I	AND SAFETY PLAN I	ND SAFETY PLAN I	VD SAFETY PLAN I	ND SAFETY PLAN I
AFETY PLAN	AFETY PLAN	ND SAFETY PLAN	ND SAFETY PLAN	ND SAFETY PLAN	ND SAFETY PLAN	AND SAFETY PLAN	AND SAFETY PLAN	AND SAFETY PLAN	ND SAFETY PLAN	VD SAFETY PLAN	ND SAFETY PLAN
AFETY PLAN	AFETY PLAN	ND SAFETY PLAN	ND SAFETY PLAN	ND SAFETY PLAN	ND SAFETY PLAN	AND SAFETY PLAN	AND SAFETY PLAN	AND SAFETY PLAN	ND SAFETY PLAN	VID SAFETY PLAN	ND SAFETY PLAN
AFETY PLAN	AFETY PLAN	ND SAFETY PLAN	ND SAFETY PLAN	ND SAFETY PLAN	ND SAFETY PLAN	AND SAFETY PLAN	AND SAFETY PLAN	AND SAFETY PLAN	ND SAFETY PLAN	VD SAFETY PLAN	ND SAFETY PLAN
AFETY PLAI	AFETY PLAI	ND SAFETY PLAI	ND SAFETY PLAI	ND SAFETY PLAI	ND SAFETY PLAI	AND SAFETY PLAI	AND SAFETY PLAI	AND SAFETY PLAI	VD SAFETY PLAI	VD SAFETY PLAI	ND SAFETY PLAI
AFETY PLA	AFETY PLA	ND SAFETY PLA	ND SAFETY PLA	ND SAFETY PLA	ND SAFETY PLA	AND SAFETY PLA	AND SAFETY PLA	AND SAFETY PLA	VD SAFETY PLA	VD SAFETY PLA	ND SAFETY PLA
AFETY PLA	AFETY PLA	ND SAFETY PLA	ND SAFETY PLA	ND SAFETY PLA	ND SAFETY PLA	AND SAFETY PLA	AND SAFETY PLA	AND SAFETY PLA	ND SAFETY PLA	VD SAFETY PLA	ND SAFETY PLA
AFETY PL	AFETY PL.	ND SAFETY PL	ND SAFETY PL	ND SAFETY PL	ND SAFETY PL	AND SAFETY PL.	AND SAFETY PL.	AND SAFETY PL.	VD SAFETY PL	VD SAFETY PL.	ND SAFETY PL.
AFETY PL	AFETY PL	ND SAFETY PL	ND SAFETY PL	ND SAFETY PL	ND SAFETY PL	AND SAFETY PL	AND SAFETY PL	AND SAFETY PL	VD SAFETY PL	VD SAFETY PL	ND SAFETY PL
AFETY PI	AFETY PI	ND SAFETY PI	ND SAFETY PI	ND SAFETY PI	ND SAFETY PI	AND SAFETY PI	AND SAFETY PI	AND SAFETY PI	VD SAFETY PI	VD SAFETY PI	ND SAFETY PI
AFETY P	AFETY P	ND SAFETY P	ND SAFETY P	ND SAFETY P	ND SAFETY P	AND SAFETY P	AND SAFETY P	AND SAFETY P	VD SAFETY P	VD SAFETY P	ND SAFETY P
AFETY I	AFETY I	ND SAFETY I	ND SAFETY I	ND SAFETY I	ND SAFETY I	AND SAFETY I	AND SAFETY I	AND SAFETY I	VD SAFETY I	VD SAFETY I	ND SAFETY I
AFETY	AFETY	ND SAFETY	ND SAFETY	ND SAFETY	ND SAFETY	AND SAFETY	AND SAFETY	AND SAFETY	ND SAFETY	VD SAFETY	ND SAFETY
AFETY	AFETY	ND SAFETY	ND SAFETY	ND SAFETY	ND SAFETY	AND SAFETY	AND SAFETY	AND SAFETY	VD SAFETY	VD SAFETY	ND SAFETY
AFET)	AFET)	ND SAFET)	ND SAFET)	ND SAFET)	ND SAFET)	AND SAFET)	AND SAFET)	AND SAFET)	VD SAFET)	VD SAFET)	ND SAFET)
AFET	AFET	ND SAFET	ND SAFET	ND SAFET	ND SAFET	AND SAFET	AND SAFET	AND SAFET	VD SAFET	VD SAFET	ND SAFET
AFET	AFET	ND SAFET	ND SAFET	ND SAFET	ND SAFET	AND SAFET	AND SAFET	AND SAFET	VD SAFET	VD SAFET	ND SAFET
AFE	AFE	ND SAFE	ND SAFE	ND SAFE	ND SAFE	AND SAFE	AND SAFE	AND SAFE	VD SAFE	VD SAFE	ND SAFE
AFE	AFE	ND SAFE	ND SAFE	ND SAFE	ND SAFE	AND SAFE	AND SAFE	AND SAFE	VD SAFE	VD SAFE	ND SAFE
AE]	AF]	ND SAF	ND SAF	ND SAF	ND SAF	AND SAF	AND SAF	AND SAF	VD SAF	VD SAF	ND SAF
AF	AF	ND SAF	ND SAF	ND SAF	ND SAF	AND SAF	AND SAF	AND SAF	VD SAF	VD SAF	ND SAF
Z	Z	ND SA	ND SA	ND SA	ND SA	AND SAI	AND SAI	AND SAI	VD SAI	VD SA	ND SA
⋖	⋖	ND SA	ND SA	ND SA	ND SA	AND SA	AND SA	AND SA	VD SA	VD SA	ND SA
~	~~	ND SA	ND SA	ND SA	ND SA	AND SA	AND SA	AND SA	VD SA	VD S/	ND SA
		ND S	ND S	ND S	ND S	AND S.	AND S.	AND S.	VD S	JD S	ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON		ND S
്ഗ		ND	ND	ND	ND	AND	AND	AND	D	P	N
		ND	ND	ND	ND	AND	AND	AND	5	D	S
	્હ	N	N	N	N	AND	AND	AND			
	0,	Z	Z	Z	Z	ANI	ANI	ANI	F	5	F
	. 53	Z	Z	Z	Z	AN	AN	AN			7
Ω		Z	Z	Z	Z	AN	AN	AN	~		Z
\Box	<u> </u>					A	A	A			
Ð	D				_	V	⋖	⋖			
N	ND S					∴≪	⋖	⋖	_		
N	ND S						~~	٠,٠,٠			_
AND	AND 5	•	•	₹ 1.					7		-
AND	AND 9	< ₹	< ₹	~ ✓,	- 4				A	A	K
AND	AND 9	_₹	_₹	~	1				A	A	⋖
IAND	I AND 9	V	V	Y			-		[A]	IAN	IA
HAND	HAND 9	HA	HA	ΥH	H	I	\pm	I	HAI	HAN	HA
HAND	H AND 9	HA	H	$H \wedge$	H	H	H	H	HAI	HAN	HA
TH AND	TH AND	[H]	[H]	H	HI	H	LH	LH	[HA]	[HA]	[HA
TH AND	TH AND 8	$^{\prime}$ TH	$^{\prime}$ TH	$^{\prime}\mathrm{HI}$	THI	TH	TH	TH	THA	THA	THA
THAND	TH AND 5	THA	THA	$_{ m TH}$	TH	TH	TH	TH	THAL	THA	THA
LTH AND	LTH AND S	LTHA	LTHA	LTHA	LTH	LTH	LTH	LTH	LTHAI	LTHA	LTHA
LTH AND	LTH AND S	LTHA	LTHA	LTHA	LTH	LTH	LTH	LTH	LTHA	LTHAN	LTHA
ALTH AND	ALTH AND S	ALTH A	ALTH A	ALTH A	ALTH A	ALTH	ALTH	ALTH	ALTH AL	ALTHAN	ALTHA
ALTH AND	ALTH AND S	ALTHA	ALTHA	ALTHA	ALTH	ALTH	ALTH	ALTH	ALTH AL	ALTH AN	ALTHA
ALTH AND	EALTH AND S	ALTHA	ALTHA	ALTHA	ALTH	ALTH	ALTH	ALTH	ALTHAI	ALTH AN	ALTHA
EALTH AND	EALTH AND S	EALTHA	EALTHA	EALTHA	EALTH /	EALTH	EALTH	EALTH	EALTHA	EALTH AN	EALTHA
	Ω		_	_							
~ r ^	- r	NDS	NDS	ND 5	NDS	AND 5	AND 5	AND 5	J S	US	ND S
r r	- r	ND 5	ND 5	ND 5	NDS	AND 5	AND 5	AND 5	J S	US	ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	ZD S	JD S	ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON	S ON	ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	VD S	S CI	ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON	S O	ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	VD S	UD S	ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON	S O	ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	VD S	S CI	ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	VD S	S CIV	ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON		ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON	S CI	ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON		ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON		ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON		ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON		ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON		ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON	US S	ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON	US S	ND S
		ND S	ND S	ND S	ND S	AND S	AND S	AND S	S ON	S CI	ND S
	r 🔨	ND S	ND S	ND S	NDS	AND 5	AND 5	AND 5	S CDS	US	ND S
~ r ^	r 🔨	ND	ND	ND	ND	AND 9	AND 9	AND 9	D	D	NDS
		ND	ND	ND	ND	AND	AND	AND	D	P	N
· • •		ND	ND	ND	ND	AND	AND	AND	P	Ð	N
. • .		ND	ND	ND	ND	AND	AND	AND	5	P	N
		ND	ND	ND	ND	AND	AND	AND	9	9	N
		ND	ND	ND	ND	AND	AND	AND	5	D	S
	· • •	ND	ND	ND	ND	AND	AND	AND	5	1	2
		ND	ND	ND	ND	AND	AND	AND	D	5	5
	. U)	N	N	N	N	AND	AND	AND	Ð	Ð	5
	. U)	N	N	N	N	AND	AND	AND			
	• • •	Z	N	N	Z	ANL	ANL	ANL			7
	0,	Z	Z	Z	Z	ANI	ANI	ANI	F	F	F
$\overline{}$	3	Z	Z	Z	Z	ANI	ANI	ANI	F		F
	. 6	Z	Z	Z	Z	AN	AN	AN	7	· 5	7
	. 53	Z	Z	Z	Z	AN	AN	AN	7	-	7
	0	Z	Z	Z	Z	AN	AN	AN	7	—	Z
□		Z	Z	Z	Z	AN	AN	AN	7	7	Z
Ω	D	Z	_	_	4	AN	AN	AN	_		
\Box	<u>D</u>	~				A	A	A			
P	US					A	\overline{A}	Ā			
5	S O				_	V	⋖	K			
S	NDS				_	⋖	K	⋖		_	
NO	ND S					∴≪	⋖	⋖	_		
N	NDS	_	_	_		. ⋖.	~~~	~~	_		
N	NDS						~~~	~~			_
N	NDS						~~~	~~	7		_
N	NDS						~~~	~~	7		_
N	NDS					. ~	~~~	~~	7		_
N	NDS					. ~	~~~	~~			_
N	ND 5			_		. ⋖.	~~~	~~	_		
N	NDS	_	_			. ⋖.	< ₹	- ⋖	_		
N	NDS					. <	< ₹	< 4			
N	ND 5					∴≪	⋖	⋖			
N	ND 5					∴≪	⋖	⋖			
N	NDS					∴≪	⋖	⋖			
N	NDS					. <	< ₹	< 4	_		
ND	ND 5						~~~	٠,٠,٠			-
AND	AND 5	< 7 `	< 0.	< 0.			1. 3005	313	4	V	~
AND	AND 9	< ₹	~ <	~ Ч	-4				A	A	K
AND	AND 9	. ⋖.	Q	. 🔍					A	A	V
VND	ND 5					~	~~~				
N	ND 5					∴≪	⋖	⋖			
N	ND 5				_	⋖	⋖	⋖	_		
9					~~	⋖	₹	₹			
P	US					A	A	A			
		~				A	A	A			
		~				A	A	A			
		~				A	A	A			
Ð	US S	~				A	A	A			-
Ð	D	_			7	A	A	A			
9					\neg	\overline{A}	\overline{A}	A			
9	ND S					⋖	K	K		-	

CDM Health and Safety Program

This document is for the exclusive use of CDM and its subcontractors.

CAMP DRESSER & McKEE INC, PROJECT DOCUMENT#;

HAZARDOUS MATERIAL SUMMARY: Circle waste type and estimate amounts by category

OTHER: Amount/Units:	Laboratory Pharmaceutical	Hospital	Radiological	Municipal	Construction Munitions Other specify:	each)
OILS: Amount/Units:	Oily Wastes Gasoline	Diesel Oil	Lubricants	PCBs	Polynuclear Aromatics Other specify:	OVERALL HAZARD EVALUATION: () High () Medium (x) Low () Unknown (Where tasks have different hazards, evaluate each)
SOLVENTS: Amount/Units:	Halogenated (chloro, bromo) Solvents	Hydrocarbons	Alcohols	Ketones	Ethers Other specify:) Unknown (Where tasks)
SLUDGES: Amount/Units:	Paints Pigments	Metals Sludges	POTW Sludge	Aluminum	Distillation Bottoms Other specify:	() Medium (x) Low (
SOLIDS: Amount/Units:	Flyash Mine or Mill Tailings	Asbestos	Ferrous Smelter	Non-Ferrous Smelter	Metals Other specify: Barium in groundwater measured at 1.65 ppm	/ALUATION: () High
CHEMICALS: Amount/Units:	Acids Pickling Liquors	Caustics	Pesticides	Dyes / Inks	Cyanides Phenols Halogens Other specify:	OVERALL HAZARD EV

JUSTIFICATION: No contaminants currently visible or known to exist in media that CDM will contact.

FIRE/EXPLOSION POTENTIAL: () High () Medium (x) Low () Unknown

BACKGROUND REVIEW: () COMPLETE (x) INCOMPLETE

Issued: February 18, 1997.

7
7
J
Jo
5a
ъ
Pa

	ı
F444763634	
. —	
2	
	1
~	
ORM	
	1
TT:	
	1
Z	
/ anthres	
\triangleleft	
4.67	
(PL/	
∕ 7	
L 60	ì
AFETY PLA Program	
<→	1
2.755	
ID S Safety	
VD (Safel	l
\sim	
~ ⊸~~	
التح منذ المست	
~~~a	
. <del>11</del> 30 - <del></del> 1	
	1
	ı
	1
EA]	
IEAL DM He	
	1
щ О	

This document is for the exclusive use of CDM and its subcontractors

PROJECT DOCUMENT #:

CAMP DRESSER & McKEE INC.

KNOWN CONTAMINANTS	HIGHEST OBSERVED CONCENTRATION (specify units and media)	PEL/TLV ppm or mg/m³ (specify)	IDLH ppm or mg/m³ (specify)	WARNING CONCENTRATION PPM	SYMPTOMS/EFFECTS OF ACUTE EXPOSURE	PHOTOIONIZATIO N POTENTIAL IP (eV)
Tetrachloro- ethylene	s 72,000 ppb (GW) s 33,000 ppb (S)	25 ppm	150 ppm	47 ppm	Irritated eyes, nose, throat, flushed face & neck, dizziness	9.32
Trichloro- ethylene	s 72,000 ppb (GW)	50 ppm	1,000 ppm	82 ppm	Vertigo, visual disturbance, headache, drowsiness	9.45
1,1,1-Trichloro- ethane	1,300 ppb (GW)	350 ppm	700 ppm	400 ppm	Headache, CNS depression, loss of balance, eye irritation	of 11.0
Benzene	s 200 ppb (GW)	1 ppm	500 ppm	61 ppm	Eye & nose irritation, headache, giddiness, nausea, fatigue	9.25
Toluene (skin)	s 200 ppb (GW)	50 ppm	500 ppm	1.7 ppm	Fatigue, confusion, euphoria, dizziness, headache, tears	8.82
Ethyl benzene	s 200 ppb (GW)	100 ppm	800 ppm	200 ppm	Eye & nose irritation, headache, narcosis	8.76
Xylene	s 200 ppb (GW)	100 ppm	900 ppm	2 ppm	Eye, nose & throat irritation, drowsiness, nausea, incoordination	8.44
L = Lagoon SW = Surface Water T = Tailings	OFF = Off-s U = Unknow W = Waste	ite	NA = Not available GW = Groundwater S = Soil	SL = Sludge A = Air SL = Sludge	TK = Tanks SD = Sediment D= Drums	

# HEALTH AND SAFETY PLAN FORM


CDM Health and Safety Program


use of CDM and its subcontractors This document is for the exclusive

PROJECT DOCUMENT#

CAMP DRESSER & McKEE INC.

VaporGraph

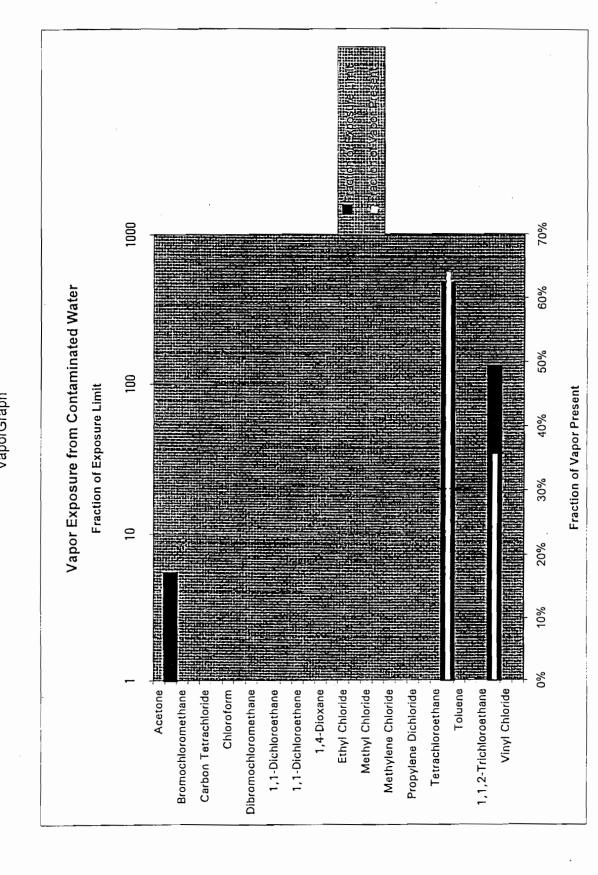

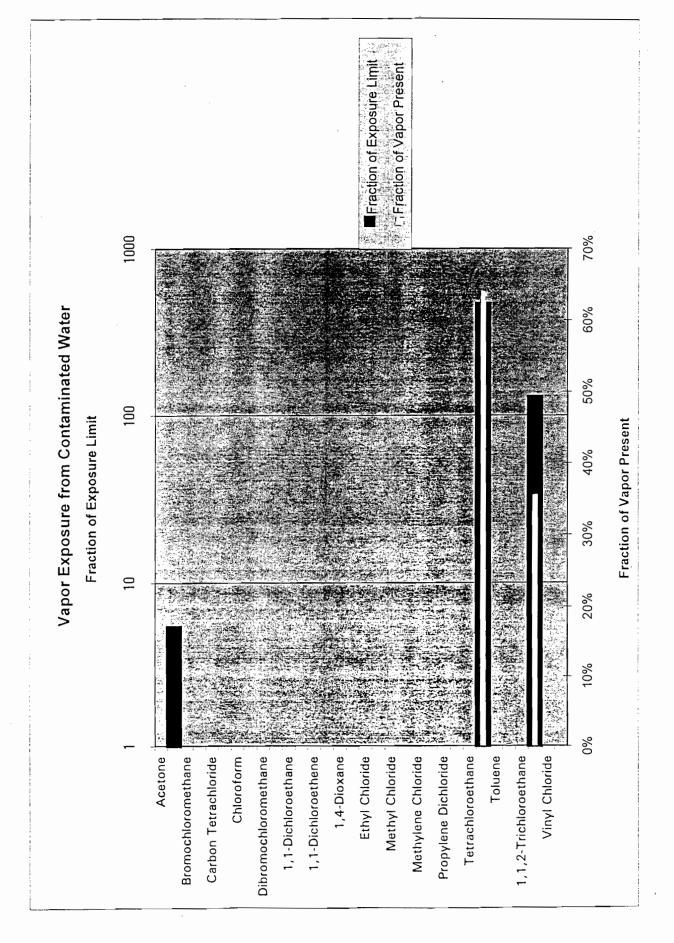

Page 1

7
-
J
9
9
86
$\sigma$
D
_

HEALTH AND SAFETY PLAN FORM	ETY PLAN FORM		This document is for the exclusive	CAMP DI	CAMP DRESSER & McKEE INC.	INC.
CDM Health and Safety Program	gram	use of CDM and	use of CDM and its subcontractors	PROJECT	PROJECT DOCUMENT #;_	and the second field of the the second by th
TASK DESCRIPTION/SPECIFIC TECHNIQUE/SITE LOCATION	IFIC TECHNIQUE/SITE	LOCATION				HAZARD &
(attach additional sheets as necessary)	essary)		TYPE	Primary	Contingency	SCHEDULE
1. Installation of soil borings and collection of split spoon samples for analysis.	l collection of split spoon sa	nples for analysis.	Intrusive	A B C	A B C D	Hi Med Cow
			Non-intrusive	Modified	Exit Area	Spring '97
2. Installation of groundwater monitoring wells with hollow-stem auger.	onitoring wells with hollow	-stem auger.	Intrusive	A B C	A B C D	Hi Med Cow
			Non-intrusive	Modified	Exit Area	Spring '97
3. Collection of groundwater samples from 18 wells by pump and manual bailer.	nples from 18 wells by pum	p and manual bailer.	Intrusive	A B C	A B C D	Hi Med (Low)
			Non-intrusive	(Modified	Exit Area	Spring '97
4			Intrusive	ABCD	ABCD	Hi Med Low
			Non-intrusive	Modified	Exit Area	
			Intrusive	ABCD	ABCD	Hi Med Low
			Non-intrusive	Modified	Exit Area	
6.			Intrusive	A B C D	ABCD	Hi Med Low
			Non-intrusive	Modified	Exit Area	
PERSONNEL AND RESPONSIBLITIES	VSIBLITIES					-
NAME	FIRM/DIVISION	CDM HEALTH CLEARANCE	RESPONSIBILITIES		Ö	On site?
David Keil	EMAV/WBY	B-T/D-S	Project Manager		(1)	3 - 4 - 5
Brian Murtagh	EMAV/WBY	D-T	Monitoring Well/Soil Boring Installation	Boring Installation	1 - 2 - 0	3 - 4 - 5
Frank Robinson	EMAV/WBY	B-T/D-S	Environmental Sampling	ng	(1)- (2)-(	3 - 4 - 5
Brian Kearney	EMAV/WBY	C-T	Environmental Sampling	Bu	(1) - (2) - (	3 - 4 - 5
		·			1 - 2 -	3 - 4 - 5
·					1 - 2 -	3 - 4 - 5
Issued: February 18, 1997.						Dogs 6 of 11

# Page 7 of 11

# HEALTH AND SAFETY PLAN FORM

01 - 6

Prot. Clothing ( ) Not needed Prot. Clothing ( ) Not needed Gloves: ( ) Not Needed Gloves: ( ) Not Needed ) Hearing Protection ( ) Encapsulated Suit: ) Encapsulated Suit: ) Hearing Protection ) Saranex Coveral! ) Flotation Device ) Saranex Coverall Other: Specify below Other: Specify below ( ) Flotation Device CAMP DRESSER & McKEE INC. ( ) Cloth Coverall: ) Cloth Coverall: ) Tyvek Coverall ) Tyvek Coverall ( ) Undergloves: ( ) Undergloves: ) Traffic Vests ( ) Overgloves: ) Traffic Vests ) Splash Suit: ) Overgloves: ) Splash Suit: Sun Screen ) Sun Screen ( ) Tick Spray ) Tick Spray ( ) Gloves: ) Gloves: ) Apron: ( ) Other: ) Apron: ) Other: PROJECT DOCUMENT PROTECTIVE EQUIPMENT: Specify by task. Indicate type and/or material, as necessary. Group tasks if possible. Use copies of this sheet if needed ( ) Steel Shank ( ) Steel Shank Head and Eye: ( ) Not needed Head and Eye: ( ) Not needed ( ) Leather Respiratory: ( ) Not needed Respiratory: ( ) Not needed ( ) Leather Boots: ( ) Not Needed 300ts: ( ) Not Needed EXIT AREA () SCBA, Airline: ( ) Safety Glasses: ( ) SCBA, Airline: ( ) Safety Glasses: ( ) Escape Mask: () Escape Mask: ( ) Face Shield: ( ) Face Shield: ( ) Overboots: ( ) Overboots: Steel-Toe ( ) Steel-Toe ) Cartridge: ( ) Hard Hat: ) Cartridge: ( ) Hard Hat: ( ) Goggles: ( ) Goggles: () Rubber () Rubber ( ) Other: () Other: ( ) Other: ( ) Other: ) APR: ) APR: use of CDM and its subcontractors This document is for the exclusive BLOCKDBLOCK B (x) Contingency ) × D ) Contingency ) Primary Primary Э B D Э D В LEVEL: Modified ٧ -€ - 8 - 9 - 5 đ ٦ -**TASKS:** 9 - 9 - Z - I TASKS: OI - 6 Prot. Clothing ( ) Not needed Prot. Clothing ( ) Not needed (x) Undergloves: For Contact Gloves: ( ) Not Needed Gloves: ( ) Not Needed (x) Gloves: For Contact ) Encapsulated Suit: ( ) Hearing Protection ) Hearing Protection ( ) Encapsulated Suit: ( ) Flotation Device ) Saranex Coverall ) Flotation Device ( ) Saranex Coverall Other: Specify below Other: Specify below (x) Cloth Coverall: ) Cloth Coverall: ) Tyvek Coveral ) Tyvek Coverall ( ) Undergloves: ( ) Traffic Vests ) Traffic Vests ( ) Overgloves: ) Splash Suit: ( ) Overgloves: ) Splash Suit: ) Sun Screen (x) Sun Screen () Tick Spray Tick Spray ) Gloves: ) Apron: ) Other: ) Apron: ( ) Other: (x) Steel Shank ( ) Steel Shank Head and Eye: ( ) Not needed Head and Eye: ( ) Not needed ( ) Leather (x) Leather Respiratory: (x) Not needed Respiratory: ( ) Not needed CDM Health and Safety Program (x) Overboots: If Muddy Boots: ( ) Not Needed Boots: ( ) Not Needed () SCBA, Airline: (x) Safety Glasses: () SCBA, Airline: ( ) Safety Glasses: ( ) Escape Mask: ( ) Escape Mask: ( ) Face Shield: ( ) Face Shield: ( ) Overboots: (x) Steel-Toe ( ) Steel-Toe ( ) Cartridge: (x) Hard Hat: ( ) Cartridge: ( ) Hard Hat: ( ) Goggles: () Goggles: () Rubber ) Rubber ( ) Other: ( ) Other: () Other: APR: ( ) APR: **BLOCK A** (x) Primary Yrismiry ( ) ) Contingency ) ) - 5 - \$ 1 - 2 - B TEAEF: TYZKZ: Modified D Э -٧ **FEAET**:

**TASKS**:

-9-5

- 6

- ε

Page 8 of 11	
	age 8 of 11
	1

HEALTH AND SAFETY CDM Health and Safety Program	HEALTH AND SAFETY PLAN FORM CDM Health and Safety Program	This document is for the exclusive use of CDM and its subcontractors.	CAMP DRESSER & McKEE INC. PROJECT DOCUMENT #:
MONITORINGE	QUIPMENT: Specify by task. Indicate type a	MONITORING EQUIPMENT: Specify by task. Indicate type as necessary. Attach additional sheets if needed.	
INSTRUMENT	TASK ACTION G	GUIDELINES	COMMENTS (When and how will you use the monitor?)
Combustible Gas Indicator	(1-2)3-4-5-6-7-8 0-10%LEL 10-25%LEL >25%LEL 21.0%O ₂ <21.0%O ₂ <19.5%O ₂	No explosion hazard. Potential explosion hazard; notify SHSC. Explosion hazard; interupt task/evacuate. Oxygen normal. Oxygen Deficient; notify SHSC. Interrupt task/evacuate.	(x) Not Needed
Radiation Survey Meter	(1-2)3-4-5-6-7-8 3x Background: >2mR/hr:	Notify HSM Establish REZ.	( ) Not Needed Measure organic vapor continually. Compare action levels to time-averaged breathing zone measurements.
Photoionization Detector OVM eV Lamp	(1-2-3) 4-5-6-7-8 0-20 ppm: >20 ppm:	Level D Leave area. Call HSM	( ) Not Needed May be used as a alternate to the PID instrument.
Type:			
Flame Ionization Detector	(1-2-3) 4-5-6-7-8 Specify:		(x) Not Needed
Type: OVA			
Detector Tubes	1-2-3-4-5-6-7-8 Specify:		( ) Not Needed
Type:			
Respirable Dust Monitor	(1-2-)3-4-5-6-7-8 If team sees visible conditions that pro	-6-7-8 If team sees visible concentrations of dust in air, or dry, windy conditions that produce dust, they will leave the area.	Not Needed
Type:			
Other Specify:	(1-2)3-4-5-6-7-8 If team notices unusual they will leave the area.	- 6 - 7 - 8 If team notices unusual odors, or irritation of the eye or throat, they will leave the area.	
   Issued: February 18, 1997.			Page 8 of 11

HEALTH AND SAFETY PLAN FORM CDM Health and Safety Program	M This document is for the exclusive use of GDM and its subcontractors	CAMP DRESSER & McKEE INC. PROJECT DOCUMENT #:
DECONTAMINATION PROCEDURES		
ATTACH SITE MAP INDICATI	ATTACH SITE MAP INDICATING EXCLUSION, DECONTAMINATION, AND SUPPORT ZONES AS PAGE TWO	PORT ZONES AS PAGE TWO
Personnel Decontamination Summarize below or attach diagram;	Sampling Equipment Decontamination Summarize below or attach diagram;	Heavy Equipment Decontamination Summarize below or attach diagram;
Team members will remove their protective clothing in the following order:	- Bag all disposable sampling and PPE equipment	A decontamination pad will be constructed for deconning all heavy equipment used at the site. The
- Equipment drop - Boot cover (if worn) removal	- Wash/rinse the outside of sample containers in soapy/clean water	rinses between each monitoring well and borehole. All rods, augers, etc., shall be deconned between
- Outer glove removal - Hard hat removal	- Wash all non-disposable sampling equipment in low sudsing detergent (Alconox or equivalent)	
- Coverall removal - Respirator (if worn) removal	- Use Laboratory brush or equivalent; disassemble equipment when necessary	
- Surgical glove removal - Hand and face wash	- Follow with tap water rinse, and distilled water rinse	
( ) Not needed	( ) Not needed	( ) Not needed
Containment and Disposal Method	Containment and Disposal Method	Containment and Disposal Method
Waste generated during this investigation will be containerized and stored on-site in 55 gallon drums and a frac tank. The contractor will be responsible for disposal of all waste-generated materials.	Waste generated during this investigation will be containerized and stored on-site in 55 gallon drums and a frac tank. The contractor will be responsible for disposal of all waste-generated materials.	Waste generated during this investigation will be containerized and stored on-site in 55 gallon drums and a frac tank. The contractor will be responsible for disposal of all waste-generated materials.
Issued: February 18, 1997.		11 Jan 9 900 G

# Page 9b of 11

# HEALTH AND SAFETY PLAN FORM

CDM Health and Safety Program

This document is for the exclusive rise of CDM and its subcontractors

CAMP DRESSER & McKEEINC, PROJECT DOCUMENT #:

Dersonalized Decontamination (1) Not Needed	Not Needed Sampling Engineent Decontamination (1) Not Needed	Heavy Equipment Decontamination
h diagram; discuss use of	2	Summarize below and/or attach diagram; work zones.
Personal decontamination station will move from location to location based on work site.	All sampling equipment will be throughly decontaminated between samples with soap, water, and then rinsing.	All down-hole equipment and tool parts that contact excavated soil are constructed of heavy gauge steel and have no natural or synthetic components that could absorb and relain most soil-hone organic contaminants.
Wash well before hand-to-mouth contact is made.	These tools are decontaminated between use at each sampling location by a four-step cleaning process. These steps are:	The drill rig, augers, and any other large equipment in the exclusion zone shall be steam cleaned prior to movement
love pir	<ol> <li>Immersion and vigorous scrubbing in a mild solution of laboratory grade detergent until all visual accumulations of soil are removed.</li> </ol>	Soil gas probes shall be decontaminated in the same fashion as drill rig equipment.
(4) boot covers (4) outer gloves (8) face and hand wash	2. Thorough rinsing with potable water.	
WASH HANDS AND FACE PRIOR TO ANY	3. Spray rinsing with deionized grade water.	
	4. Air dry.	
Containment and Disposal Method	Containment and Disposal Method	Containment and Disposal Method
Wash solutions and removed soils may be allowed to return to the ground from which they came. Unless containerized wastes are hazardous, dispose with office.	Wash solutions and removed soils may be allowed to return to the ground from which they came. Unless containerized wastes are hazardous, dispose with office	Wash solutions and removed soils may be allowed to return to the ground from which they came. Unless containerized wastes are hazardous, dispose with office
builing waste stream. Dispose of hazardous wastes through a site-specific waste disposal contract.	builing waste stream. Dispose of hazardous wastes through a site-specific waste disposal contract.	-
HAZARDOUS MATERIALS INVENTORY (Investigation-Associated Substances: Attach MSDS)	sociated Substances: Attach MSDS) Copy "   " to mark answers	nark answers
Preservatives	<u>Decontamination</u>	Calibration Gases and Fluids
() Hydrochloric Acid (HCI) () Ascorbic Acid () Nitric Acid (HNO ₃ ) () Other: () Sulfuric Acid (H ₂ SO ₄ ) () Other: () Sodium Acide (NaOH)	( ) Alconox TM ( ) Hexane ( ) Liquinox TM ( ) Isopropanol ( ) Acetone ( ) Nitric Acid ( ) Methanol ( ) Other:	( ) Isobutylene ( ) Propane ( ) Methane ( ) pH Standard ( ) Canductivity ( ) Pentane ( ) Hydroen

HEALTH AND SAFETY PLAN FORM	FORM This document is for the exclusive	for the exclusive	CAMP DRESSER & McKEE INC.	dckee inc.
CDM Health and Safety Program	use of CDM and I	use of CDM and its subcontractors.	PROJECT DOCUMENT#:	", LN
EMERGENCY CONTACTS		EMERGENCY CONTACTS	NAME	PHONE
Water Supply:		Health and Safety Manager	Lisa Granados	(908) 225-7000
Site Telephone:		Project Manager	David Keil	(516) 496-8400
EPA Release Report #:		Site Safety Coordinator	Brian Murtagh	(516) 496-8400
CDM 24-Hour Emergency #:	1(800) SKY-PAGE 31821#	Client Contact	Shawn O'Hara	(972) 868-2444
	(010) 247-440	Other (specify)		
Office (specify)	0000 101 (000)1	Environmental Agency	NYSDEC	
CHEMIKEC Emergency #:	1(800) 424-9300	State Spill Number		1 (800) 457-7362
CONTINGENCY PLANS: Summarize below		Fire Department		(516) 547-4121 Or 911
	T (1)	Police Department		911
An intrustive work to take place in modified bever D. Exceedances of action limits will not require the upgrade of personnel protective equipment.	rsonnel protective equipment.	State Police		(518) 458-6305
Exceedances will require work stoppage until acceptable conditions return.	l acceptable conditions return.	Health Department		(516) 853-3056
		Poison Control Center		(516) 542-2323
		Occupational Physician	David Barnes	1 (800) 229-3674
		MEDICAL EMERGENCY		PHONE
		Hospital Name: Central General Hospital	eral Hospital	
		Hospital Address: 888 Old Country Road, Plainview, New York	Country Road, Plainviev	w, New York
		Name of 24-Hour Ambulance:	:	911
		Route to Hospital: Attached.		
		Distance to hospital: ~3 miles	Se	
HEALTH AND SAFERY PLAN APPROVALS	S	Attach map with route to hospital: Broad Hollow Road north to LIE Exit 49 west. Follow LIE to Exit 48. South on Round Swamp Road to Old Country	spital: Broad Hollow R South on Round Swan	Soad north to LIE Exit 49
Prepared by:	Date 2/27/87		Road west to Central C	Follow Old Country Road west to Central General Hospital (on the
DHSC Signature	Date Date 25/97	ngnt).		
Hant alguature	Dalle 1 - 1 1			
15800d: February 18 1997				D. 10. C11

Issued: February 18, 1997.

# DREW B. BENNETT Senior Environmental Scientist Camp Dresser & McKee

### Summary

Mr. Bennett has 13 years of experience in hydrology, water resources management, contamination remediation, environmental management, and air toxics. He has conducted numerous studies relating to groundwater supply development, urban hydrology, remedial action designs for both groundwater and soil cleanups, natural systems for wastewater treatment, non-point source impacts on estuaries, and groundwater/surface water interactions. He has also provided environmental management support for large industrial facilities, and is experienced in industrial air pollution source sampling and analysis.

## Experience

Mr. Bennett has 13 years of experience in environmental engineering and science. He has solved environmental and regulatory related problems by integrating engineering, technology, planning, research, and community participation as required. He has participated in numerous public and private sector projects involving water supply, water resource management, water quality improvement, land development, environmental management of industrial facilities, industrial site redevelopment, hazardous and industrial waste remediation, and resource restoration.

Mr. Bennett manages site contamination or other regulated materials that may be encountered during upgrade of the Spring Creek Auxiliary WPCP. The facility is a NYCDEP CSO storage facility and pump station located in Brooklyn, New York. Mr. Bennett's responsibilities include identifying regulated materials in areas of future excavation, influent barrels, and areas of the existing facility, and preparing design and contract documents for remediation. Regulated materials include landfill, lead-coated surfaces and electrical cables, asbestos, mercury, PCBs, USTs, and 6,000 cubic yards of debris and settlement in influent barrels.

As project manager and senior scientist for the Brookfield Avenue landfill remediation project on Staten Island, New York, Mr. Bennett is directing a team of engineers and scientists in the RI/FS, risk assessment and remedial design for this 200-acre inactive hazardous waste site owned by NYCDEP. The remedial investigation phase of the project involves intensive, state-of-the art investigations of air impacts, gas production, solid waste hot spots and groundwater/surface water impacts. He is working closely with NYSDEC, the community, and a Scientific Advisory Committee to address significant public concerns and maximize state EQBA funding for the project. The project is following a presumptive approach of remediating "hot spots" and containment via capping, landfill gas and leachate control. In addition, Mr. Bennett completed a 3D groundwater model of this complicated site. The model is guiding the RI and is being used to respond to the Community/Scientific Advisory Committee's questions on the potential exposure pathways in the complex hydrogeology. Specific issues include private wells, a mass balance of leachate as it travels through the groundwater/surface water

system, evaluation of the significance of buried river channels, and the potential for leachate leakage to deeper aquifers caused by extensive regional water supply pumping.

Mr. Bennett was assistant project manager for a critical path soil remediation plan and remedial action for a private client developing an industrial site on Long Island, New York. The site contained 18 underground storage tanks (USTs) and 45,000 cubic yards of soil mixed with refuse incinerator ash. He directed the preparation of a feasibility study, remediation plan, risk assessment, bid documents, and remediation contractor oversight during the reclamation of the site for future industrial use.

Mr. Bennett was the project hydrologist for the design of a groundwater remediation system for the Waldwick Aerospace site in Monmouth County, New Jersey. He assisted in the development of a three-dimensional groundwater model to aid field hydrogeologic investigations, defined required extraction rates to capture the solvent plume prior to discharge to a nearby stream, evaluated the impact of pumping on nearby riparian wetlands, and developed mitigation measures. He worked closely with CDM's wetland scientists and EPA's Biological Technical Assistance Group in resolving wetland impact issues.

Mr. Bennett is the quality assurance officer for the NYSDEC Standby Contract for Hazardous Waste Remediation Services. In this capacity, he is responsible for reinforcement of CDM's Quality Management Process. He reviews all project deliverables for technical accuracy and overall quality of work, performs project audits, assists in developing project specific quality assurance plans, resolves data problems, and directs the preparation of data usability reports.

Mr. Bennett is the senior scientist for the design and operation of remedial systems for contaminated soil and groundwater at the SMS Instruments Superfund site in Deer Park, New York. For the soil remediation system, Mr. Bennett prepared a treatability study that evaluated various forms of soil vapor extraction (SVE) technology to effectively remove volatile and semi-volatile soil contaminants. Based on this study, Mr. Bennett prepared performance-based specifications for bidding the construction and operation of an SVE system. The SVE system successfully achieved NYSDEC/EPA derived soil cleanup criteria. For the design of the groundwater pump and treat system, Mr. Bennett was responsible for the groundwater pump tests and the groundwater extraction and recharge well system. He currently monitors and evaluates the performance of the 100-gpm system and recommends operational changes as necessary.

For an industrial client's site on Long Island, Mr. Bennett directed an air sparging/soil venting pilot study involving groundwater highly contaminated with gasoline and a residual saturation zone below the water table. The objective of the pilot study was to cost-effectively remediate hot spots as a source control. In addition to optimizing extraction and injection rates, Mr. Bennett evaluated the

soil stripping and biodegradation treatment mechanisms associated with sparging. The process was selected for full-scale design and implementation over a 30-acre site.

For the John F. Kennedy Space Center in Florida, Mr. Bennett participated in the preparation of a RCRA facility investigation and the closure of two 150,000-gallon holding lagoons in compliance with RCRA regulations. He was responsible for the delineation of contaminants and for preparation of detailed closure plans and groundwater monitoring plans. He also assisted in preparing the RCRA Part B application.

Mr. Bennett provided consulting, construction, and operation services for a 75-gpm groundwater pump and treat project to remediate an off-site plume and control a DNAPL source. In addition to the groundwater extraction-recharge design, he provided construction management and system startup services.

As part of a remedial investigation of gasoline-contaminated groundwater at a large petrochemical distributor on Long Island, Mr. Bennett was the task manager for a soils vapor contamination monitoring program designed to monitor and evaluate the potential of trace gasoline vapors in residential home basements. Working closely with regulatory agencies and the local health department, Mr. Bennett developed a standardized monitoring program. He was also responsible for air emission stack testing of a number of sources associated with remedial activities.

For EPA, Mr. Bennett provided technical review of a RCRA Part B permit application for a petrochemical complex undergoing decommissioning in Puerto Rico. The application included four SWMU groups totaling 32 individual units. Active units included two aeration basins receiving wastewater produced by corrective actions and an industrial landfill which continues to receive hazardous wastes from the decommissioning process.

Mr. Bennett developed and calibrated three-dimensional groundwater flow and contaminant transport models for the Brookhaven National Laboratory's remediation program for Operable Units 1, 4, 5 and 6. Multiple source areas were addressed, including two landfills, waste pits, hazardous waste storage facilities, STP effluent recharge areas, and experimental agricultural fields. Model applications were used to identify source areas, guide field investigations, remedial alternative evaluations, and remedial designs. Mr. Bennett completed the engineering evaluation/cost analysis phase, and was responsible for pump testing, integrating operable units, and design of the groundwater extraction and recharge basin systems.

Education

M.S. - Environmental Engineering Sciences, University of Florida, 1989 B.S. - Hydrology, University of New Hampshire, 1982

Registrations

Professional Groundwater Hydrologist

Honors

NASA Graduate Assistantship

1991 Kenneth Allen Memorial Award from NYWPCA for the paper "Retrofitting for Watershed Drainage."

Memberships

Water Environment Federation Long Island Water Conference American Institute of Hydrology

FEB 1 6 1997

# ERI

INVE

August 12, 1996

Mr. Robert R. Stewart Comprehensive Environmental Services

Environmental Engineer I

New York State Department of Environmental Conservation

Building 40- SUNY

Stony Brook, NY 11790-2356

Re:

Additional Investigation Update

25 Melville Park Road, Melville, NY

Dear Mr. Stewart:

This letter is to update you on the results of the recent investigation work conducted at the 25 Melville Park Road site located in Melville, New York. In addition, you have indicated in previous phone conversations that you were considering requiring my client to perform a soil vapor survey through the concrete slab in the building. We appreciate your concern, however, based on the results of the recent investigations, we feel strongly that this work is not warranted. Below is a discussion of the recent work performed and the reasons why we believe that additional source investigation work is not necessary.

# July, 1996 Investigations

As you know, Environmental Remediation, Inc.'s (ERI's) work scope included the installation of additional groundwater monitoring points and the collection of additional soil and groundwater data. The purpose of this work was first to further evaluate the nature and extent of impacted soil and groundwater on the subject property. Specifically, the goals included defining the contamination source area detected near MW-13 and to evaluate the vertical extent of the contamination.

Two deep groundwater monitoring wells were installed to establish the vertical extent of the contamination. One well (MW-16D) was placed near the southern property border. The objective of this well was to monitor the deep groundwater at the property border and to evaluate whether contamination was moving off-site. A second well (MW-13D) was installed adjacent to MW-13. The purpose of this second deep well was to evaluate the vertical extent of the groundwater contamination in the vicinity of the contamination source. The deep wells were extended to 90 feet below grade (fbg). At the MW-16D location, hydropunch groundwater samples were collected at selected intervals prior to installing the permanent well. At the MW-13D location, soil samples were collected at selected intervals above and below the water table.

One additional groundwater monitoring well (MW-17) was also installed in the eastern parking lot at your request. The monitoring well was installed directly downgradient of your metal detector anomaly.

Several additional hydropunch points were installed to collect groundwater samples. Two hydropunch points were advanced to approximately five feet below the water table in the vicinity of well MW-13. The purpose of these wells was to evaluate the source area of the contamination which was previously detected in well MW-13.

One hydropunch groundwater sample (HP-7) was collected north of the building and west of existing hydropunch point HP-5. The purpose of this point was to evaluate at your request the area downgradient of the second abandoned waste oil UST. One hydropunch groundwater sample (HP-5) was previously advanced in this area during an earlier investigation. Low levels of VOCs were detected in this previous hydropunch groundwater sample.

Four soil samples were analyzed from the MW-13D soil boring. Boring MW-13D was extended to 90 fbg (40 feet below the water table). Soil samples collected from 45 fbg, 62 fbg, 67 fbg and 75 to 77 fbg were submitted for laboratory analysis. PCE was detected in the 45 fbg sample at 1,000 ug/kg. By comparison, PCE was detected in the 62 fbg sample at 200 ug/kg and was not detected in either of the deeper samples. The 45 fbg sample was collected above the water table.

At your request, one sediment sample collected from the catch basin located in the loading dock area was analyzed. The catch basin was noted to have approximately one half of one foot of sediment in the basin. No VOCs were detected in the sediment sample.

Groundwater samples were collected via a hydropunch sampler and from selected monitoring wells. The hydropunch was used to collect groundwater samples at selected depth intervals (61, 76 and 86 fbg) from well MW-16D. Well MW-16D is located near the southern property boundary. The 76 fbg groundwater sample had a level of 9,800 ug/L PCE detected. By comparison, the 61 fbg groundwater sample (collected near the water table) had 300 ug/L PCE detected. The deepest hydropunch groundwater sample (collected at 86 fbg) had a level of 2,600 PCE detected.

In addition to the hydropunch samples collected near the property border, two hydropunch groundwater samples (HP-8 and HP-9) were collected near the suspected source of the contamination (see figure). PCE at 30,500,000 ug/L was detected in HP-8. In HP-9, PCE was detected at 122,100 ug/L. The compounds TCA and PCE were also detected in these two hydropunch groundwater samples. TCA was detected as high as 142,700 ug/L (HP-8) and TCE as high as 498,300 ug/L (HP-8).

One final hydropunch groundwater sample (HP-7) was collected north of the building and downgradient of the second abandoned waste oil UST. PCE at 16 ug/L was detected in this sample.

To supplement the hydropunch groundwater samples, three groundwater samples were collected from the two deep monitoring wells (MW-13D and MW-16D) and one water table well MW-17 located in the eastern parking lot. PCE was detected in the MW-13D groundwater sample at a level of 5,800 ug/L. In the MW-16D groundwater sample (near the southern property border), PCE was detected at 1,200 ug/L. The PCE level detected in MW-17 was 21 ug/L. A summary of the groundwater analytical results is attached.

Based upon the available data, soils under the subject site appear to have been impacted by VOCs in the vicinity of the east loading dock (Figures 2,3). PCE was detected in the soil above the NYSDEC cleanup objective for soil (1,400 ug/kg) in the sample collected from the MW-13 soil boring at 54--54.7 fbg (33,000 ug/kg). PCE was detected below the NYSDEC cleanup objective in the samples collected from MW-12 (45-47 fbg), MW-13 (45-47 fbg) at 180 ug/kg and MW-13D (45 fbg) at 1,000 ug/kg. Wells MW-13 and MW-13D are located east of the loading dock area. The surrounding monitoring wells (MW-14, MW-15 and MW-8) did not have any VOCs detected in the soil samples. Hence, it appears that the horizontal extent of the soil VOC contamination is limited to the area immediately surrounding well MW-13. The vertical extent appears to be limited to an approximate 10 foot zone near the top of the water table. It should be noted, however, that some amount of residual contamination (PCE, TCE and other related compounds) is also present below the water table.

The attached figures show the relative horizontal and vertical distribution of individual VOCs in the groundwater. In general, all of the compounds mapped (PCE, TCE and TCA) were detected in the highest concentrations near well MW-13, HP-8 and HP-9. Of these sampling points, HP-8 had three orders of magnitude higher levels of PCE detected and two orders of magnitude higher levels of TCA and TCE detected. PCE was detected above the solubility limits (in HP-8) and likely occurs as a free phase in the vicinity of HP-8. The HP-2 hydropunch groundwater sample was collected directly northeast of and approximately 20 feet upgradient of HP-8. PCE was detected at 28 ug/L. This relative difference in PCE concentrations between HP-2 and H-8 indicates that HP-8 is near the source of the contamination while HP-2 is upgradient or north of the source.

The horizontal extent of the PCE contamination and other VOC compounds extends south of the HP-8, HP-9 and MW-13 area to the property boundary. The concentrations detected at the water table decrease to 300 ug/L in the MW-16D (61 fbg) groundwater sample. MW-16D is located near the southern property boundary. The eastern extent of the contamination appears to be coincident with the property border. Samples collected from wells MW-2 and MW-3 (near the property border) had relatively low levels of PCE detected (120 and 110 ug/L, respectively).

The vertical extent of the groundwater contamination was evaluated near the source area. The deep groundwater sample collected from MW-13D showed roughly an order of magnitude decrease in PCE concentration (5,800 ug/L) as compared to the level (59,000 ug/L) previously detected from the groundwater sample (MW-13). Hence, the concentration of the PCE appears to be decreasing with depth.

The vertical extent of the contamination was also evaluated near the southern property boundary (downgradient of the source area). The hydropunch groundwater sample collected from 76 fbg (MW-16D) had levels of 9,800 ug/L PCE detected. By comparison, the hydropunch samples collected near the water table surface (61 fbg) and at a deeper depth (86 fbg) had relatively lower levels detected equaling 300 and 2,600 ug/L, respectively. The sample collected from the permanent monitoring well MW-16D (screened from 80 to 90 fbg) had levels of 1,200 ug/L detected. Overall, it appears that the highest levels of PCE contamination were detected near the water table surface (shallow zone) near the source area and at the 70 to 80 fbg zone downgradient of the source area and near the southern property boundary.

Based on the levels of PCE and other related compounds in the groundwater (MW-16D samples) near the border of the 25 Melville Park Road property, it appears that some contamination is migrating off-site. However, the data indicate that there is a four order of magnitude decrease in the PCE concentrations between the source area and the levels detected near the property border. This decrease infers that the extent of the off-site contamination is limited.

The elevated levels of PCE, TCE and TCA detected in hydropunch groundwater sample HP-8 indicate that the source of the contamination is near to that sampling point. An upgradient hydropunch groundwater sampling point (HP-2) shows a marked decrease in the levels of contaminants detected. Similarly, the detected levels of contaminants fall off to the east (MW-17) and to the west (MW-13 and MW-14) of point HP-8. Based on the groundwater direction (south/southeast), it appears that the source of the PCE and other related solvent contamination is in the direct vicinity of HP-8 or just to the north/northwest of HP-8.

As presented in the previous Preliminary Remedial Action Plan (PRAP) report, it was first believed that the discharge or diffusion well which was reportedly located near the southeastern corner of the building was the source of the contamination. However, information obtained from the Suffolk County Health Department indicates that the diffusion well was cased from the ground surface to 108 fbg. Inconsistently, the highest level of PCE contamination at the site was detected near the water table surface (58 fbg). PCE and most of the other compounds detected are denser than water and tend to sink through the water column. Therefore, it is unlikely that a source at 108 fbg caused the highest contamination to occur at 58 fbg.

As an alternative, a review of the historic New York Twist Drill plans (also obtained from the Health Department) indicates that the former drum storage racks were located in the corner of the building near HP-8. In addition, a waste oil drain leading to a 2,500 gallon waste oil holding tank under the eastern parking lot is shown in a hand drawn sketch (also provided by the Health Department). According to the ground penetrating radar survey, the waste oil tank is no longer present. Based on the distribution of contamination detected in the groundwater, it is possible that the pipe leading from the oil drain to the tank leaked on route and contributed to the source area contamination.

### Conclusions

In sum, based on the results on the recent investigations presented above we feel strongly that the additional soil vapor study is not warranted for the following reasons:

- 1. New data suggests that we have found the source at HP-8 as discussed above. Therefore, there does not appear to be a need to perform this work.
- 2. Regardless of whether we have actually intercepted the exact source location or are just downgradient of it, we have delineated the plume on the down and crossgradient portions as indicated by the current maps.
- 3. The remedial actions set forth in the Work Plans are designed to intercept the majority of the contaminant plume and abate the contamination regardless of whether it's coming from the corner of the building or from under the center of the slab. Therefore, there is no reason to probe beneath the slab.
- 4. Past Air sampling (presented in the PRAP) indicates that tenants in the building are not currently exposed to solvent concentrations in excess of OSHA employee standards.
- 5. My client has been operating under the premise that since the contamination is migrating south-southeast of the building and the plume can be captured by remediation of the downgradient portions of the plume, that they will not be required to jeopardize the integrity of the building by performing investigative or remedial activities that will affect the usable interior space of the building in any manner.
  - If New York State Department of Environmental Conservation (NYSDEC) is considering something of this nature, my client requires a formal request in writing, stating exactly what is necessary and why, so that they fully understand the implications of conducting this work. My client has indicated that this may affect their willingness to proceed with this project, since the occupied tenant space is the main reason for them pursuing the clean-up of this site.
- 6. My client has tried to focus their resources on the contaminant issues and the resolution of those issues. The additional work performed to date, some of which was performed at your request, has only provided a greater comfort level regarding the previously obtained data and conclusions and has resulted in significant costs to my client, including several thousand dollars in consulting fees and subcontractors fees.

The well installed east of the building, where previous GPR work had not identified an anomaly, confirmed that there was not an issue in this area. The results from the additional hydropunch installed downgradient of the two waste tanks north of the building were consistent with previously available data. The catch basin (that was installed in 1985) was sampled per your request and did not identify contamination.

In summary, we do not think additional investigation under the building is warranted or reasonable. Every extra cost and delay forces my client to weigh their decision to go forward with this agreement and clean-up. Please notify us once NYSDEC has had an opportunity to review the data contained in this letter, so that we can move forward with the agreement, the foreclosure and the ultimate goal of remediation. Additionally, we have not yet received written comments concerning the PRAP, which was submitted in May. We must have the NYSDEC's comments on the PRAP, including proposed soil and groundwater cleanup levels and remediation technology, before we can proceed.

 
If you have any questions, please do not hesitate to call me.


Sincerely,


George G. Gurney, CPG, LSP


Senior Hydrogeologist

nom invest



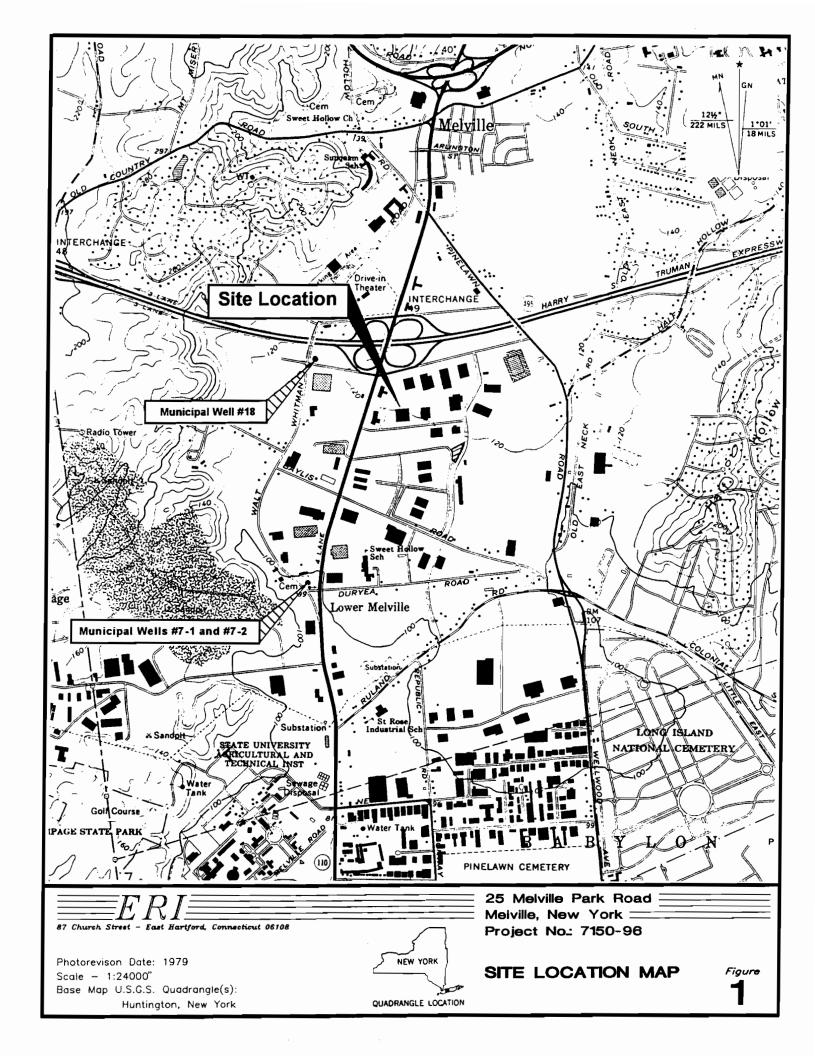

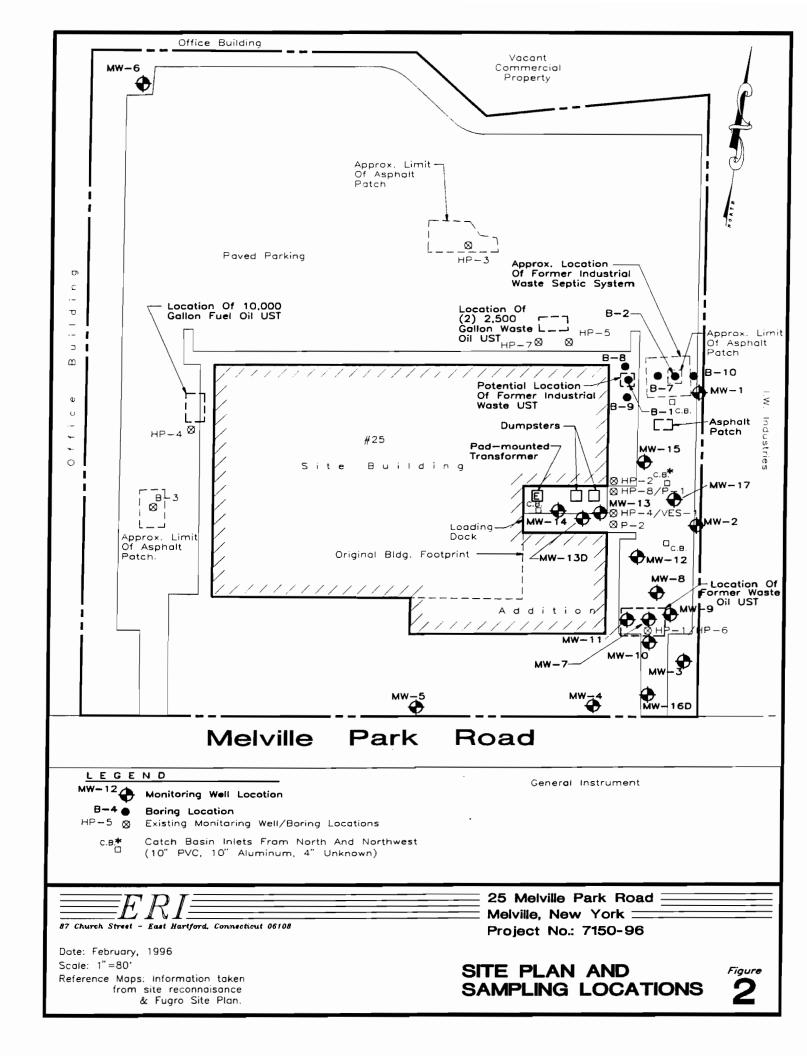

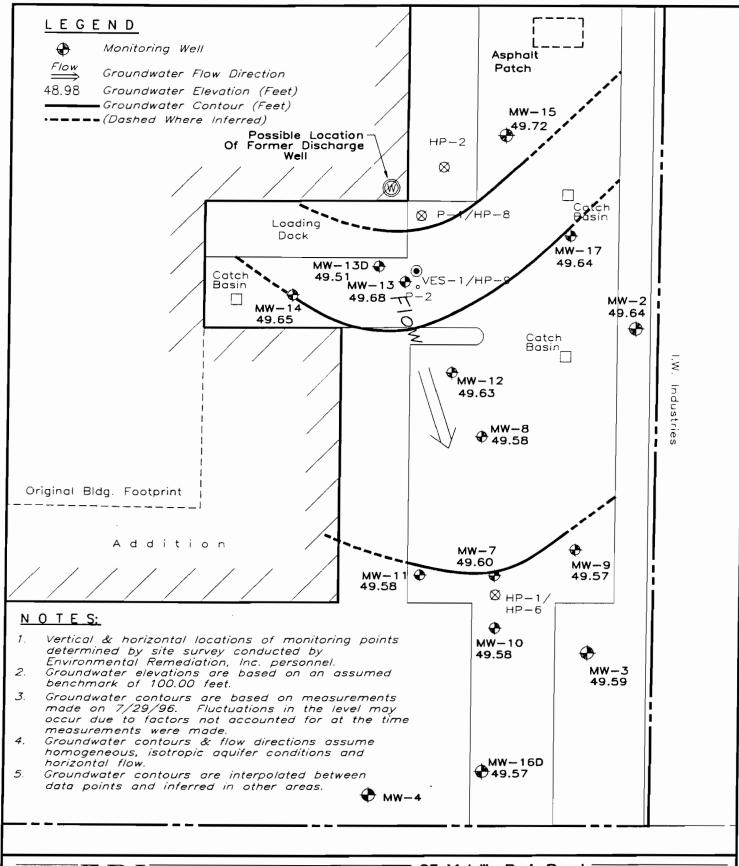

37 Church Street – East Hartj	ord, Connectiout 06108	

Date: August, 1996 Scale: 1"= 30'


Reference Maps: Information taken from site reconnaisance & Fugro Site Plan.

25 Melville Park Road Melville, New York

Project No.: 7150-96

GROUNDWATER CONTOUR MAP

Figure 3

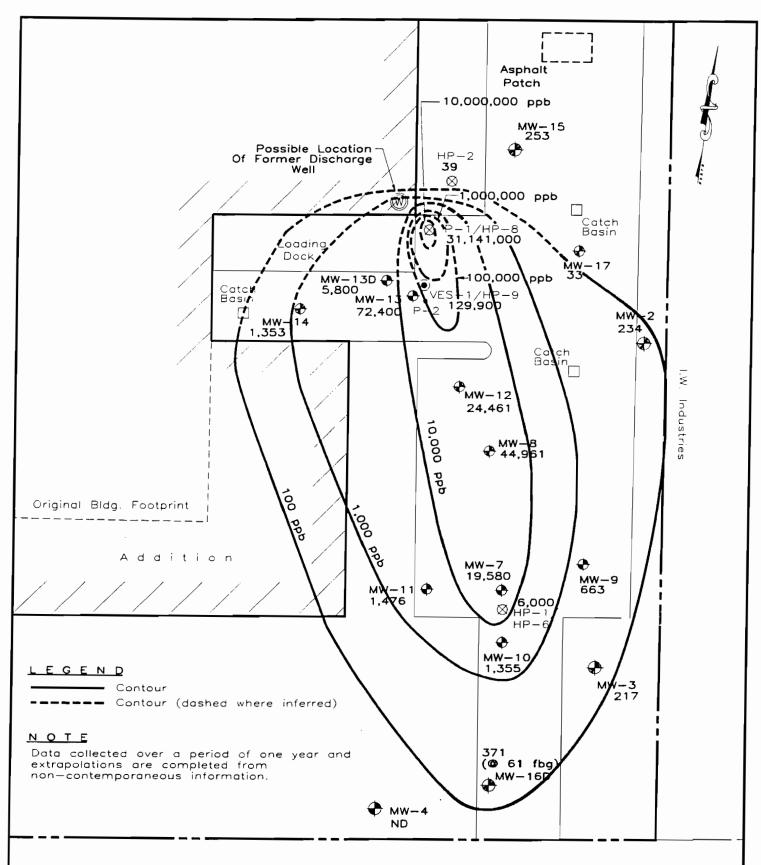


=FRI===================================	25 Mei
87 Church Street - East Hartford, Connecticut 06108	Melville, Project

Date: August, 1996 Scale: 1" = 30'

Reference Maps: Information taken from site reconnaisance & Fugro Site Plan.

TVOC CONCENTRATIONS
IN SHALLOW GROUNDWATER

Figure

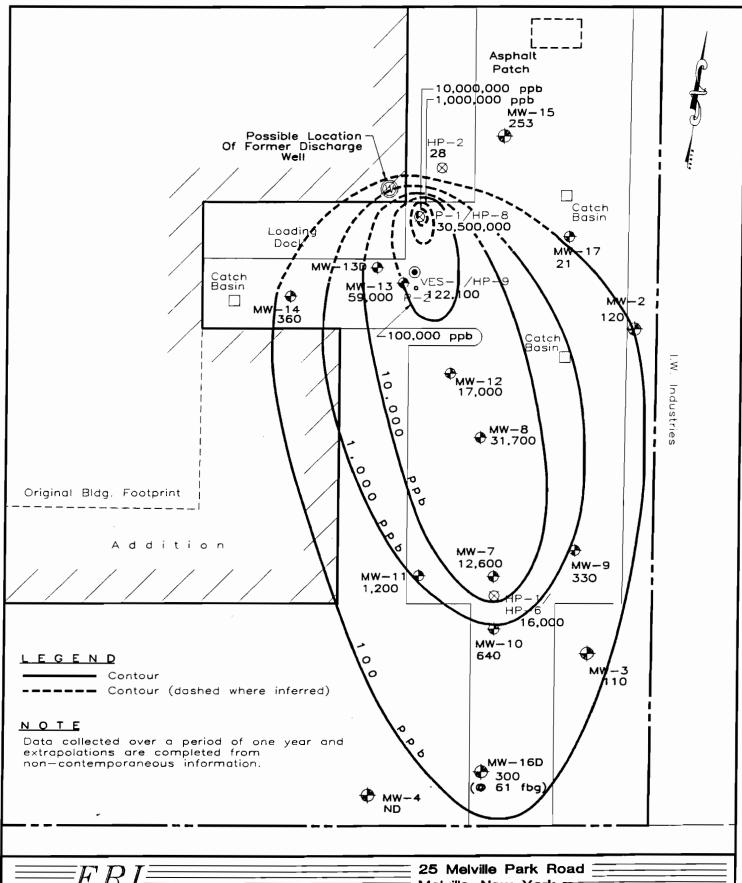


Date: August, 1996 Scale: 1'' = 30'

Reference Maps: Information taken from site reconnaisance & Fugro Site Plan.

Melville, New York

Project No.: 7150-96

PCE CONCENTRATIONS Figure IN SHALLOW GROUNDWATER

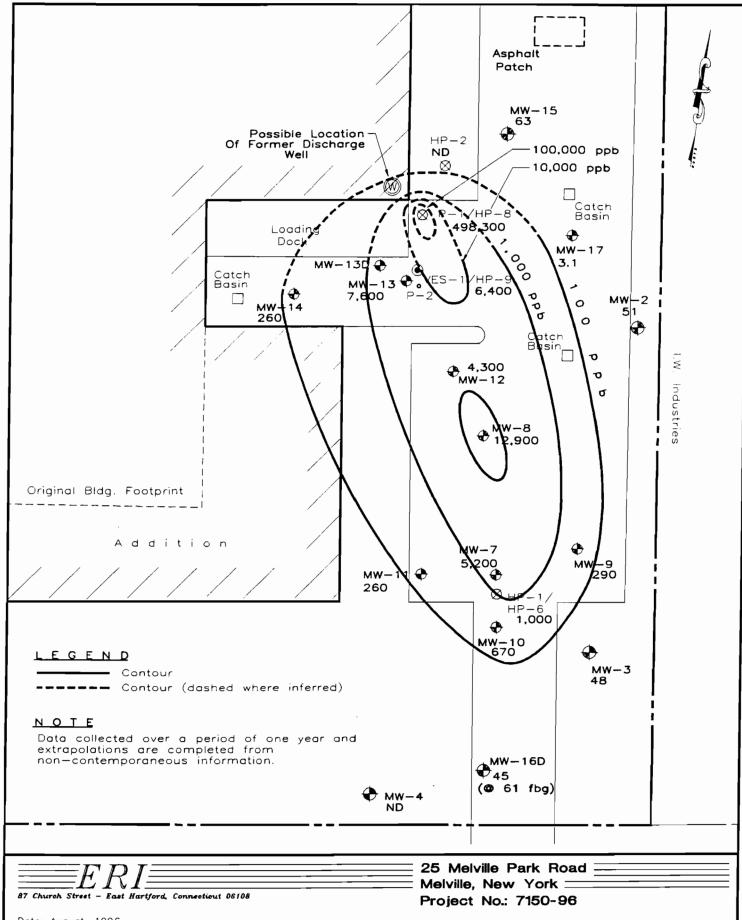


Date: August, 1996

Scale: 1" = 30' Reference Maps: Information taken from site reconnaisance & Fugro Site Plan.

TCE CONCENTRATIONS IN SHALLOW GROUNDWATER


Figure

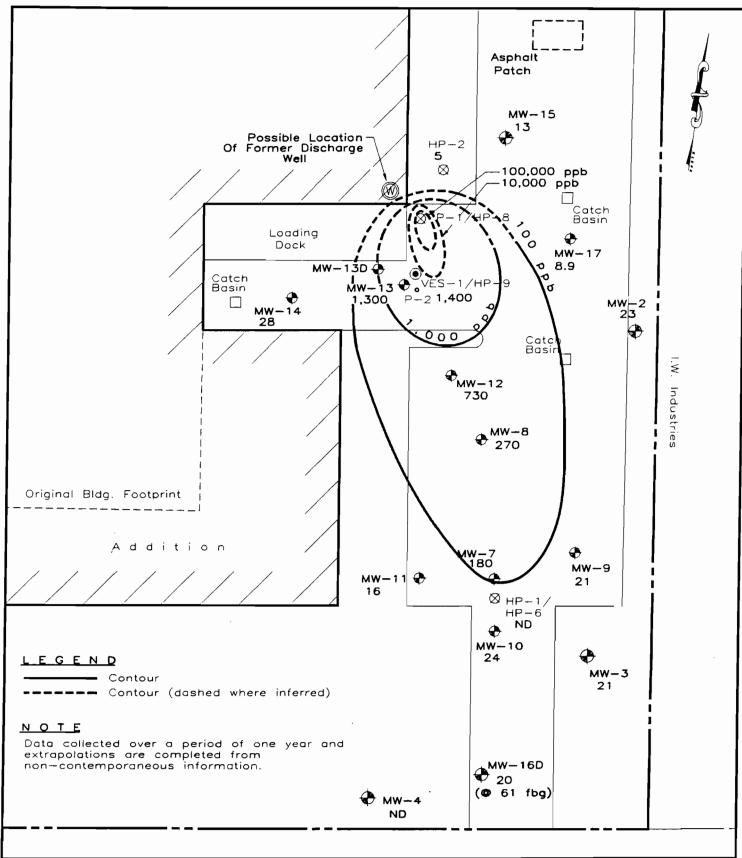

7 Church Street - East Hartford, Connecticut 08108	25 Melville Park Road Melville, New York Project No.: 7150-96
Date: August, 1996	

Scale: 1"= 30'
Reference Maps: Information taken from site reconnaisance & Fugro Site Plan.

1,1,1-TCA CONCENTRATIONS Figur

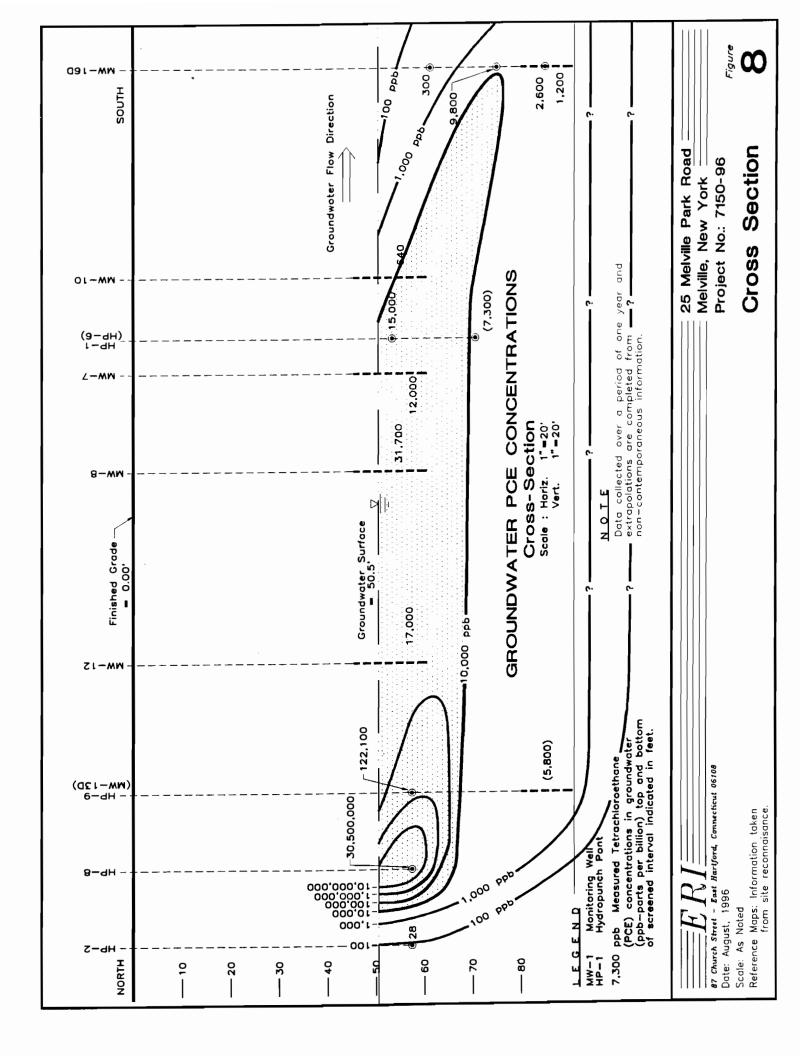

 


TABLE 1

## PREVIOUS SOIL ANALYTICAL RESULTS FROM DECEMBER 19 AND 20, 1994 25 MELVILLE PARK ROAD MELVILLE, NEW YORK

Analyte	HP-1	HP-2	HP-4	HP-5	B-1	B-2	B-3	NYSDEC Soil Cleanup Objective
TPH	BDL	26	BDL	BDL	35	420	BDL	NS
13-PP METALS								
arsenic	BDL	BDL	N/A	1.5	2.4	1.6	1.9	7.5
chromium	1.5	2.2	N/A	2.6	5.5	2.9	2.5	10
copper	BDL	2.8	N/A	BDL	24	4.8	BDL	25
mercury	BDL	BDL	N/A	BDL	BDL	1.8	BDL	0.1
lead	1.2	3.1	N/A	1.1	5.5	2.2	1.1	SB
zinc	4.3	5.5	N.A	4.4	17	6.8	4.5	20
cyanide	BDL	BDL	N/A	BDL	BDL	24	BDL	NS
рН	6.7	7.7	N/A	7.2	8.0	8.0	6.5	NS

Results presented in milligrams per kilogram

TPH =Total petroleum hydrocarbons by gas chromatography using flame ionization detection

13 PP METALS =13 Priority Pollutant Metals

Standard = NYSDEC Technical and Administrative Guidance Memorandum (TAGM) No. HWR-94-4046

N/A Not analyzed

BDL Below laboratory detection limits

NS No standard

SB Site background

All other target compounds not listed were below laboratory detection limits

TABLE 2

PREVIOUS SOIL ANALYTICAL RESULTS FROM JANUARY 25, 1995
25 MELVILLE PARK ROAD
MELVILLE, NEW YORK

Sample I.D.	Sample Depth (feet)	HNu (ppm)	VOCs (ug/kg)	TPH (mg/kg)
HP6/1012	10-12	88	BDL (1)	BDL
HP6/2022	20-22	195	BDL (1)	BDL
HP6/3032	30-32	250	BDL (1)	BDL
HP6/4042	40-42	175	BDL (1)	BDL
HP6/BTTM*	45-50	92	BDL (1)	BDL
B4/5-7	5-7	130	BDL (1)	BDL
B4/15-17	15-17	12	BDL (1)	BDL
B5/5-7	5-7	10	BDL (1)	BDL
B5/15-17	15-17	4	BDL (1)	BDL
B6/5-7	5-7	8	BDL (1)	BDL
B6/15-17	15-17	5	BDL (1)	BDL
MW-8	5-7	BDL	NA	NA
MW-8	10-12	BDL	NA	NA
MW-9	5-7	BDL	NA	NA
MW-9	10-12	BDL	NA	NA
MW-10	5-7	4.8	NA	NA
MW-10	10-12	3.1	NA	NA
MW-11	5-7	44.7	NA	NA
MW-11	10-12	472	BDL (2)	NA

^{*} Sample was collected off the auger due to lack of spoon sample recovery and is believed to be from a depth of approximately 45 to 50 feet.

HNu -field screening of samples with HNu photoionization detector

ppm -parts per million

ug/kg -micrograms per kilogram

⁽¹⁾ VOCs -laboratory analysis of volatile organic compounds by EPA Method 8260

⁽²⁾ VOCs -laboratory analysis of volatile organic compounds by EPA Method 8120

TPH -laboratory analysis of total petroleum hydrocarbons by gas chromatography

BDL -compound(s) not detected above minimum laboratory detection limits

TABLE 3

# PREVIOUS GROUNDWATER ANALYTICAL RESULTS 25 MELVILLE PARK ROAD MELVILLE, NEW YORK (IN UG/L)

COMPOUND	1,1-DCA	cis-1,2-DCE	trans-1,2- DCE	PCE	1,1,1-TCA	TCE
MW-1 (12/20/94)	BDL	BDL	BDL	23	5	BDL
MW-2 (12/20/94)	5	35	BDL	120	23	51
MW-3 (12/20/94)	10	28	BDL	110	21	48
MW-4 (12/20/94)	BDL	BDL	BDL	BDL	BDL	BDL
MW-5 (12/20/94)	BDL	BDL	BDL	BDL	BDL	BDL
MW-6 (12/20/94)	BDL	BDL	BDL	BDL	BDL	BDL
MW-7 (1/25/95)	BDL	1,600	BDL	12,600	180	5,200
MW-7 (5/31/95)	25	BDL	52	8,300	61	3,200
MW-8 (5/31/95)	17	BDL	65	31,700	270	12,900
MW-9 (5/31/95)	8.1	BDL	14	330	21	290
MW-10 (5/31/95)	8.7	BDL	12	640	24	670
MW-11 (5/31/95)	BDL	BDL	BDL	1,200	16	260
HP-1 (12/20/94)	BDL	BDL	BDL	15,000	BDL	1,100
HP-2 (12/20/94)	BDL	6	BDL	28	5	BDL
HP-4 (12/20/94)	BDL	BDL	BDL	BDL	BDL	BDL
HP-5 (12/20/94)	BDL	BDL	BDL	5	BDL	BDL
HP-6 (1/25/95)	BDL	630	BDL	7,300	80	1,800
STANDARD	NS	'70	100	5	200	5

### Notes:

Sampling dates indicated in parentheses.

DCA -dichloroethane

DCE -dichloroethene

PCE -perchloroethene

TCA -trichloroethane

BDL -Below laboratory detection limits

NS -No standard

TABLE 4

# SOILS FIELD SCREENING DATA MONITORING WELLS 25 MELVILLE PARK ROAD MELVILLE, NEW YORK

Location	Sample Depth (fbg)	HNu Measurement (ppm)
MW-12	0.5-2.5	0.0
	2.5-4.5	0.0
	10-12	0.0
	20-22	0.0
	30-32	0.0
	40-42	0.0
	45-47	9.0
	50-52	2.0
	55-56.5	30.
	56.5-57	7.0
MW-13	0.5-2.5	0.0
	05-10	0.0
	15-17	0.0
	25-27	0.0
	35-37	0.0
	40-42	1.0
	45-47	2.0
	50-52	40.
	54-54'8"	. 120.*
	54'8"-55'8"	50.
MW-13D	40-42	0.0
	45.5-45.8	40.0
-	50-52	14
	55-57	11.0
	60-62	30.0
	65-67	3.0
	70-72	NR
	75-77	NR
MW-14	03-05	2.5
	08-10	2.0
	18-20	2.0
	28-30	0.0
	38-40	0.0
	43-45	0.5
	48-50	1.0
	53-55	1.5

# TABLE 4 (continued)

# SOILS FIELD SCREENING DATA MONITORING WELLS 25 MELVILLE PARK ROAD MELVILLE, NEW YORK

Location	Sample Depth (fbg)	HNu Measurement (ppm)
MW-15	0.5-2.5	0.0
	10-12	0.0
	20-22	0.0
	30-32	0.0
	40-42	0.0
	45-47	0.0
	50-52	0.5
	55-57	1.0
MW-16D	20-22	0.0
	40-42	0.0
	61	0.0

^{* -} ambient screening due to insufficient sample volume for head space screening

TABLE 5

# SOILS FIELD SCREENING DATA SOIL BORINGS 25 MELVILLE PARK ROAD MELVILLE, NEW YORK

Location	Sample Depth (fbg)	HNu Measurement (ppm)
SB-7	01-03	0.0
_	05-07	0.0
SB-7A	10-12	0.0
	15-17	
	20-22	0.0
SB-8	01-03	0.0
	05-07	0.0
	10-12	0.0
	15-17	0.0
	20-22	0.0
SB-9	01-03	0.0
	05-07	0.0
	10-12	0.0
	15-17	0.0*
	20-22	0.0
SB-10	01-03	0.0
	05-07	0.0
	10-12	0.0
	15-17	0,0
	20-22	0.0

^{* -} ambient screening due to insufficient sample volume for head space screening

TABLE 6

# MONITORING WELL CONSTRUCTION SUMMARY 25 MELVILLE PARK ROAD MELVILLE, NEW YORK

Well Designation	Well Depth	Screened Interval	Elevation
MW-1*	NA	NA	101.80 feet
MW-2*	NA	NA	100.57 feet
MW-3*	NA	NA NA	101.10 feet
MW-4*	NA	NA	100.69 feet
MW-5*	NA	NA_	101.19 feet
MW-6*	NA	NA	101.81 feet
MW-7*	60.0	40-60	100.54 feet
MW-8	60.0	40-60	100.00 feet
MW-9	60.0	45.0-60.0	100.20 feet
MW-10	60.0	45.0-60.0	100.70 feet
MW-11	60.0	45.0-60.0	101.31 feet
MW-12	56.5	46.5-56.5	100.39 feet
MW-13	58	48-58	100.44 feet
MW-14	56	46-56	99.09 feet
MW-15	58.5	48.5-58.5	99.82 feet
MW-13D	90.0	80.0-90.0	100.42 feet
MW-16D	89.5	79.5-89.5	100.82 feet
MW-17	60.0	50-60	99.72 feet

^{* -} Installed by others (Pre 1995)

¹⁻ Elevation based on an arbitrary datum (MW-8)
2- Well depths and screened intervals presented in "feet below grade".

# TABLE 7

# GROUNDWATER ELEVATION SURVEY 25 Melville Park Road Melville, New York July 29, 1996

Well Location	Elevation	Depth To Water	Water Level Elevation
MW-2	100.57	50.93	49.64
MW-3	101.10	51.51	49.59
MW-7	100.51	50.91	49.60
MW-8	100.00	50.42	49.58
MW-9	100.20	50.63	49.57
MW-10	100.70	51.12	49.58
MW-11	101.31	51.73	49.58
MW-12	100.39	50.76	49.63
MW-13	100.44	50.76	49.68
MW-13D	100.42	50.91	49.51
MW-14	99.09	49.44	49.65
MW-15	99.82	50.10	49.72
MW-16D	100.82	51.25	49.57
MW-17	99.76	50.12	49.64

## Notes:

Elevations relative to arbitrary datum (MW-8 equalling 100.00). Elevations in feet.

## SOIL ANALYTICAL SUMMARY Phase I (March 1996) 25 MELVILLE PARK ROAD MELVILLE, NEW YORK FEBRUARY 29 - MARCH 4, 1996

					_	1		7	J
NYSDEC Soff Cleanup Objective	7.5 or SB	300 OR SB	10 OR SB	SB	SB	1,400	N/A	N/A	N/A
SB-10 05-07	2.5	- 07	8	2.1	2	QN.	QN.	QN	250
SB-9 20-22	0.5	489	QN	0.7	CIN	, QN	QN	21	ON
SB-8 15-17	QN	89	QN	9,0	ON.	QN	QN	ON	QN
SB-7A 10-12	QN	23	QN.	0.5	ON.	ON	CIN	QN	ON.
MW15 50-52	NA	NA	NA	NA	NA	ND	QIN	ND	ON.
MW-14 MW14 MW15 03-05 43-45 50-52	NA	NA	NA	NA	NA	ON	ND ND	ND	<del>N</del>
MW-14 03-05	NA	NA	NA	NA	. NA	ON.	ND	ND	ON
MW13 54-54.7	NA	NA	NA	NA	NA	30,000	250	450	Ð
MW13 45-47	NA	NA	NA	NA	NA	180	NA	NA	NA
MW12 55-56.5	NA	NA	NA	NA	NA	ON	ON	OIN	QN
MW12 45-47	NA	NA	NA	NA	NA	180	290	1,100	ON
Units   MW12 45.47	mg/kg	mg/kg	mg/kg	mg/kg	mg/kg	ug/kg	mg/kg	mg/kg	mg/kg
Compound	arsenic	barium	chromium	lead	silver	tetrachloroethene	TPH-diesel/#2	TPH-lubricating oil	TPH-#4/#6

ND - Not detected mg/kg - milligrams per kilogram ug/kg - micrograms per kilogram * - NYSDEC TAGM:No. HWR-94-4046 Sampling depths indicated in feet below grade. NA - Not Analyzed

## SOIL ANALYTICAL SUMMARY (current investigation) SEPTIC SOIL BORINGS 25 MELVILLE PARK ROAD MELVILLE, NEW YORK FEBRUARY 29 - MARCH 4, 1996

	Units	SB-7A 10-12	SB-8 15-17	SB-9 20-22	SB-10 05-07	NYSDEC Soil Cleanup Objective
tetrachloroethene	ug/kg	ND	ND	ND	ND	1,400
TPH-diesel/#2	mg/kg	ND	ND	ND	ND	N/A
TPH-lubricating oil	mg/kg	ND	ND	21	ND	N/A
TPH-#4/#6	mg/kg	ND	ND	ND	250	N/A
arsenic	mg/kg	ND	ND	0.5	2.5	7.5 or SB
barium	mg/kg	23	58	489	20_	300 or SB
chromium	mg/kg	ND	ND	ND	8	10 or SB
lead	mg/kg	0.5	0.6	0.7	2.1	SB
silver	mg/kg	ND	ND	ND	2	SB

ND - Not detected mg/kg - milligrams per kilogram ug/kg - micrograms per kilogram NYSDEC TAGM, No. HWR-94-4046 Sample depth indicated in feet below grade

SB - Site Background

#### SOIL ANALYTICAL SUMMARY PHASE II (July, 1996) 25 MELVILLE PARK ROAD MELVILLE, NEW YORK

Compound	Units	MW13D 45'	MW13D 62'	MW13D 67'	MW13D 75-77	Catch Basin	NYSDEC Soil Cleanup Objective*
tetrachloroethene	ug/kg	1,000	200	ND	ND	ND	1,400

ND - Not detected mg/kg - milligrams per kilogram ug/kg - micrograms per kilogram * - NYSDEC TAGM:No. HWR-94-4046 Sampling depths indicated in feet below grade.

## GROUNDWATER ANALYTICAL SUMMARY PHASE I (March, 1996) 25 MELVILLE PARK ROAD MELVILLE, NEW YORK All Units in ug/L

	MW-12	MW-13	MW-14	MW-15	NYSDEC WQ Standard
tetrachloroethene	17,000	59,000	360	150	5
trichloroethene	4,300	7,600	260	63	5
cis 1,2 dichloroethene	2,000	4,500	700	13	5
1,1,1 trichloroethane	730	1,300	28	13	5
1,1 dichloroethene	30	ND*	ND	14	5
trans 1,2 dichloroethene	15	ND*	5	ND	5
ethyl benzene	22	ND*	ND	ND	5
naphthalene	7	ND*	ND	ND	10
toluene	16	ND*	ND	ND	5
1,2,4 trimethylbenzene	76	ND*	ND	ND	5
1,3,5 trimethylbenzene	35	ND*	ND	ND	5
O-xylene	110	ND*	ND	ND	5
P,M xylene	120	ND*	ND	ND	5
Total VOCs	24,461	72,400	1.353	253	N/A

ND - Not Detected above the analytical detection limit

ND* - Detection limit of 500 ug/L due to nature of sample

Bold number denotes equal to or above the NYSDEC WQ Standard.

#### ENGINEERS AND ENVIRONMENTAL SCIENTISTS

150 Trumbull Street, 4th Floor, Hartford, CT 96403 860) 549-8430 FAX (860) 549-8422

RECEIVED

JAN 2 1 1996 ARCHON GROUP, L.P.

January 16, 1997

Ms.Shawn O'Hara Archon Group, L.P. 600 Los Colinas Boulevard, Suite 1900 Irving, TX 75039

Re: Melville Data

Dear Shawn:

Enclosed are the data that you requested. You will note that a field error was made when filling out the chains and the laboratory sheets incorrectly list the sample locations. I corrected and initialed this (by hand) last summer as indicated on the laboratory sheets. Let me know if you want the laboratory to correct the sample numbers. (I would recommend this, since it is going to the regulatory agencies).

Call me if you want (me or Jeff Pearl) to talk to the laboratory. I'm sure they would make the change at no charge. Otherwise, enjoy the reading.

Very truly yours,

George G. Gurney Project Manager

## CHAIN OF CUSTODY RECORD



Page ____ of __ REPORT TO: PROJECT NO.: SITE NAME: LOCATION: STATE ADDRESS: REFERENCE QUOTE NUMBER (RQN): CITY **PURCHASE ORDER NO.:** INVOICE TO: PROJECT Mgr: SAMPLER(s): CITY STATE ZIP TPH CONTAINERS OTHER VOC's SVOC's **METALS** SAMPLE TYPE & MATRIX CODES: 1 - Soluble  $1 = 4^{\circ}C$  2 = HCI  $3 = H_2SO_4$   $4 = HNO_3$  5 = OTHER2-PAHS(8100/82 2 - Total 2-OIL/GREASE 2-GC(8015M) # OF AMBER GLASS LITERS 2-602/8020 3 - TCLP # OF GLASS SOIL JARS C = COMPOSITE G = GRAB# OF PLASTIC LITERS **PRESERVATIVE** SAMPLE TYPE # 40 ml VOA VIALS Ν̈́ 1 = AQUEOUS 3 = SLUDGE 5 = OTHER I-GC(8100M) 1-601/8010 -608/8080 2 = SOIL4 = SEDIMENT చ 1-IR(418.1 Cd PP13 LAB USE ONLY SAMPLE I.D. DATE TIME 1400 710 DATE TIME (MQUISHED BY: RECEIVED BY: 7-29.96 SPECIAL HANDLING: Please SPECIAL INSTRUCTIONS: CONfinely as check ☐ Return Sample after Analysis ☐ Dispose of Sample after 60 days ☐ Standard TAT - 7 to 10 Business days ☐ Special TAT - 24 hr - 48 hr - 72 hr - 5 b. days TAT begins when sample is received at test facility.
 TAT for samples rec'd after 3 pm will begin on the next business day. All TAT's are subject to laboratory approval and customer consent. DATE RESULTS NEEDED:

## CHAIN OF CUSTODY RECORD



SPECTRUM ANALYTICAL Page _____ of ____ REPORT TO: PROJECT NO .: SITE NAME: STATE NY LOCATION: ADDRESS: STATE CT ZIP 06/08 CITY E. Ha REFERENCE QUOTE NUMBER (RQN): INVOICE TO: **PURCHASE ORDER NO.:** PROJECT Mgr: STATE ZIP CITY SAMPLER(s): **TPH** METALS OTHER **CONTAINERS** VOC's SVOC's SAMPLE TYPE & MATRIX CODES: 2-PAHS(8100/8270  $1 = 4^{\circ}C$  2 = HCI  $3 = H_2SO_4$   $4 = HNO_3$  5 = OTHER2 - Total 2-GC(8015M) 2-602/8020 2-011/GRE 3 - TCLP 2-8260 2-EPH # OF PLASTIC LITERS # 40 ml VOA VIALS # OF AMBER GLASS L C = COMPOSITE G = GRABPRESERVATIVE 8 2-BN 1-GC(8100M) 护 1 = AQUEOUS 3 = SLUDGE5 = OTHER # OF GLASS 1-608/8080 1-601/8010 1-502/8021 2 = SOIL4 = SEDIMENT చ్ 1-IR(418.1 1-8270 RCRA8 Cd LAB USE TIME **ONLY** SAMPLE I.D. DATE 65 (DO CENAL) mw16D ow 477) DATE TIME RECEIVED BY: **BELINQUISHED BY:** SPECIAL HANDLING: Please SPECIAL INSTRUCTIONS: check ☐ Return Sample after Analysis She metals Der ☐ Dispose of Sample after 60 days ☐ Standard TAT - 7 to 10 Business days ☐ Special TAT - 24 hr - 48 hr - 72 hr - 5 b. days • TAT begins when sample is received at test facility. TAT for samples rec'd after 3 pm will begin on the next business day. • All TAT's are subject to laboratory approvar and customer consent.

DATE RESULTS NEEDED: 24 LC COI ON

Laboratory Report

Client ID: MW13D-GW

Lab ID No: AA57733

Location: Melville, NY Client Job No.:

Matrix: Water Sampled on07/29/96 by ERI Received on 07/30/96 by DDR QC and Data Review by

Preservative: Refrigeration Container: 2 VOA Vials Condition of Sample as Received: Satisfactory Delivered by: Courier

**Volatile Halocarbons** 

	EPA Methods 601/	8010		
Parameter	Result (in ug/L)	MDL	Analyzed	Analyst
Bromodichloromethane	Not detected	10	08/01/96	NB
Bromoform	Not detected	10	08/01/96	NB
Bromomethane	Not detected	10	08/01/96	NB
Carbon tetrachloride	Not detected	10	08/01/96	NB
Chlorobenzene	Not detected	10	08/01/96	NB
Chloroethane	Not detected	50	08/01/96	NB
Chloroform	Not detected	10	08/01/96	NB
Chloromethane	Not detected	50	08/01/96	NB
Dibromochloromethane	Not detected	10	08/01/96	NB
1,2-Dichlorobenzene	Not detected	10	08/01/96	NB
1,3-Dichlorobenzene	Not detected	10	08/01/96	NB
1,4-Dichlorobenzene	Not detected	10	08/01/96	NB
Dichlorodifluoromethane	Not detected	10	08/01/96	NB
1,1-Dichloroethane	Not detected	10	08/01/96	NB
1,2-Dichloroethane	Not detected	10	08/01/96	NB
1,1-Dichloroethene	Not detected	10	08/01/96	NB
trans-1,2-Dichloroethene	Not detected	10	08/01/96	NB
1,2-Dichloropropane	Not detected	10	08/01/96	NB
cis-1,3-Dichloropropene	Not detected	10	08/01/96	NB
trans-1,3-Dichloropropene	Not detected	10	08/01/96	NB
Methylene chloride	Not detected	25.0	08/01/96	NB
1,1,2,2-Tetrachloroethane	Not detected	10	08/01/96	NB
Tetrachloroethene	5,800	500	08/01/96	NB
1,1,1-Trichloroethane	Not detected	10	08/01/96	NB
1,1,2-Trichloroethane	Not detected	10	08/01/96	NB
Trichloroethene	Not detected	10	08/01/96	NB
Trichlorofluoromethane	Not detected	10	08/01/96	NB
Vinyl chloride	Not detected	10	08/01/96	NB
BCP Surrogate Recovery (%)	87		08/01/96	NB

Laboratory Report

Client ID: MW16D-GW

Location: Melville, NY

Lab ID No: AA57734

Client Job No.:

Preservative: Refrigeration Container: 2 VOA Vials Condition of Sample as Received: Satisfactory Delivered by: Courier

Matrix: Water Sampled on07/29/96 by ERI Received on 07/30/96 by DDR QC and Data Review by

Parameter	Result (in ug/L)	MDL	Analyzed	Analyst
Bromodichloromethane	1.8	1	07/31/96	NB
Bromoform	Not detected	1	07/31/96	NB
Bromomethane	Not detected	1	07/31/96	NB
Carbon tetrachloride	Not detected	1	07/31/96	NB
Chlorobenzene	Not detected	1	07/31/96	NB
Chloroethane	Not detected	5	07/31/96	NB
Chloroform	41	2	07/31/96	NB
Chloromethane	Not detected	5	07/31/96	NB
Dibromochloromethane	Not detected	1	07/31/96	NB
1,2-Dichlorobenzene	Not detected	1	07/31/96	NB
1,3-Dichlorobenzene	Not detected	1	07/31/96	NB
1,4-Dichlorobenzene	Not detected	1	07/31/96	NB
Dichlorodifluoromethane	Not detected	2	07/31/96	NB
1,1-Dichloroethane	Not detected	1	07/31/96	NB
1,2-Dichloroethane	Not detected	1	07/31/96	NB
1,1-Dichloroethene	Not detected	1	07/31/96	NB
trans-1,2-Dichloroethene	Not detected	1	07/31/96	NB
1,2-Dichloropropane	Not detected	1	07/31/96	NB
cis-1,3-Dichloropropene	Not detected	1	07/31/96	NB
trans-1,3-Dichloropropene	Not detected	1	07/31/96	NB
Methylene chloride	Not detected	5.0	07/31/96	NB
1,1,2,2-Tetrachloroethane	Not detected	1	07/31/96	NB
Tetrachloroethene	1,200	10	07/31/96	NB
1,1,1-Trichloroethane	2.9	2	07/31/96	NB
1,1,2-Trichloroethane	Not detected	1	07/31/96	NB
Trichloroethene	9.5	2	07/31/96	NB
Trichlorofluoromethane	Not detected	1	07/31/96	NB
Vinyl chloride	Not detected	1	07/31/96	NB
BCP Surrogate Recovery (%)	98		07/31/96	NB

Laboratory Report

Client ID: MW17-GW Lab ID No: AA57735

Location: Melville, NY

Client Job No.:

Matrix: Water Sampled on07/29/96 by ERI Received on 07/30/96 by DDR QC and Data Review by

Preservative: Refrigeration Container: 2 VOA Vials Condition of Sample as Received: Satisfactory Delivered by: Courier

Parameter	Result (in ug/L)	MDL	Analyzed	Analyst
Bromodichloromethane	Not detected	1	07/31/96	NB
Bromoform	Not detected	1	07/31/96	NB
Bromomethane	Not detected	1	07/31/96	NB
Carbon tetrachloride	Not detected	1	07/31/96	NB
Chlorobenzene	Not detected	1	07/31/96	NB
Chloroethane	Not detected	5	07/31/96	NB
Chloroform	1.9	1	07/31/96	NB
Chloromethane	Not detected	5	07/31/96	NB
Dibromochloromethane	Not detected	1	07/31/96	NB
1,2-Dichlorobenzene	Not detected	1	07/31/96	NB
1,3-Dichlorobenzene	Not detected	. 1	07/31/96	NB
1,4-Dichlorobenzene	Not detected	1	07/31/96	NB
Dichlorodifluoromethane	Not detected	1	07/31/96	NB
1,1-Dichloroethane	6.9	2	07/31/96	NB
1,2-Dichloroethane	Not detected	1	07/31/96	NB
1,1-Dichloroethene	Not detected	1	07/31/96	NB
trans-1,2-Dichloroethene	Not detected	1	07/31/96	NB
1,2-Dichloropropane	Not detected	1	07/31/96	NB
cis-1,3-Dichloropropene	Not detected	1	07/31/96	NB
trans-1,3-Dichloropropene	Not detected	1	07/31/96	NB
Methylene chloride	Not detected	4	07/31/96	NB
1,1,2,2-Tetrachloroethane	Not detected	1	07/31/96	NB
Tetrachloroethene	21	2	07/31/96	NB
1,1,1-Trichloroethane	8.9	2	07/31/96	NB
1,1,2-Trichloroethane	Not detected	1	07/31/96	NB
Trichloroethene	3.1	1	07/31/96	NB
Trichlorofluoromethane	Not detected	1	07/31/96	NB
Vinyl chloride	Not detected	1	07/31/96	NB
BCP Surrogate Recovery (%)	99		07/31/96	NB

Laboratory Report( Subcontracted Analyses )

Client ID: MW17-GW Lab ID No: AA57735

Location: Melville, NY

Client Job No.:

Matrix: Water Collected: 07/29/96 by ERI Received on 07/30/96 by DDR QC and Data Review by

Preservative: Refrigeration Container: 1 Plastic Liter Condition of Sample as Received: Satisfactory Delivered by: Courier

#### Total Metals (EPA Method 200.7)

Parameter	Result (mg/L)	MDL			
			Extracted	Analyzed	Analyst
Arsenic	0.067	0.010	08/01/96	08/01/96	CR
Barium	1.65	0.010	08/01/96	08/01/96	CR
Cadmium	Not detected	0.010	08/01/96	08/01/96	CR
Chromium	0.094	0.010	08/01/96	08/01/96	CR
Lead	0.076	0.005	08/01/96	08/01/96	CR
Selenium	Not detected	0.005	08/01/96	08/01/96	CR
Silver	Not detected	0.010	08/01/96	08/01/96	CR
Mercury	Not detected	0.001	08/01/96	08/01/96	CR

Laboratory Report

Client ID: CATCHBSN Lab ID No: AA57736

Location: Melville, NY

Client Job No.:

Matrix: Soil Sampled on07/29/96 by ERI Received on 07/30/96 by DDR QC and Data Review by

Preservative: Refrigeration Container: 3 VOA Vials Condition of Sample as Received: Satisfactory Delivered by: Courier

Parameter	Result (in ug/Kg)	MDL	Extracted	Analyzed	Analyst
Bromodichloromethane	Not detected	10	07/31/96	08/01/96	NB
Bromoform	Not detected	10	07/31/96	08/01/96	NB
Bromomethane	Not detected	10	07/31/96	08/01/96	NB
Carbon tetrachloride	Not detected	10	07/31/96	08/01/96	NB
Chlorobenzene	Not detected	10	07/31/96	08/01/96	NB
Chloroethane	Not detected	10	07/31/96	08/01/96	NB
Chloroform	Not detected	10	07/31/96	08/01/96	NB
Chloromethane	Not detected	10	07/31/96	08/01/96	NB
Dibromochloromethane	Not detected	10	07/31/96	08/01/96	NB
1,2-Dichlorobenzene	Not detected	10	07/31/96	08/01/96	NB
1,3-Dichlorobenzene	Not detected	10	07/31/96	08/01/96	NB
1,4-Dichlorobenzene	Not detected	10	07/31/96	08/01/96	NB
Dichlorodifluoromethane	Not detected	10	07/31/96	08/01/96	NB
1,1-Dichloroethane	Not detected	10	07/31/96	08/01/96	NB
1,2-Dichloroethane	Not detected	10	07/31/96	08/01/96	NB
1,1-Dichloroethene	Not detected	10	07/31/96	08/01/96	NB
trans-1,2-Dichloroethene	Not detected	10	07/31/96	08/01/96	NB
1,2-Dichloropropane	Not detected	10	07/31/96	08/01/96	NB
cis-1,3-Dichloropropene	Not detected	10	07/31/96	08/01/96	NB
trans-1,3-Dichloropropene	Not detected	10	07/31/96	08/01/96	NB
Methylene chloride	Not detected	25	07/31/96	08/01/96	NB
1,1,2,2-Tetrachloroethane	Not detected	10	07/31/96	08/01/96	NB
Tetrachloroethene	Not detected	20	07/31/96	08/01/96	NB
1,1,1-Trichloroethane	Not detected	10	07/31/96	08/01/96	NB
1,1,2-Trichloroethane	Not detected	10	07/31/96	08/01/96	NB
Trichloroethene	Not detected	10	07/31/96	08/01/96	NB
Trichlorofluoromethane	Not detected	10	07/31/96	08/01/96	NB
Vinyl chloride	Not detected	10	07/31/96	08/01/96	NB
BCP Surrogate Recovery (%)	92		07/31/96	08/01/96	NB
% Solids	98.1	0.1	07/31/96	07/31/96	NB

## Spectrum Analytical, Inc. Laboratory Report Supplement

#### References

Methods for the Determination of Organic Compounds in Drinking Water. EPA-600/4-88/039. EMSL 1988.

Methods for Chemical Analysis of Water and Wastes. EPA 600/4-79-020. EMSL 1983.

Methods for Organic Chemical Analysis of Municipal and Industrial Wastewater. EPA 600/4-82-057. EMSL 1982.

Test Methods for Evaluating Solid Waste. Physical/Chemical Methods. EPA SW-846. 1986.

Standard Methods for the Examination of Water and Wastes. APHA-AWWA-WPCF. 16th Edition. 1985.

Standard Methods for Comparison of Waterborne Petroleum Oils by Gas Chromatography. ASTM D 3328. 1982.

Oil Spill Identification System. U.S. Coast Guard CG-D-52-77. 1977.

Handbook for Analytical Quality Control in Water and Wastewater Laboratories. EPA 600/4-79-019. EMSL 1979.

Choosing Cost-Effective QA/QC (Quality Assurance/Quality Control) Programs for Chemical Analyses. EPA 600/4-85/056. EMSL 1985.

#### Report Notations

```
The compound was not detected at a concentration
    Not Detected,
                        equal to or above the established method detection
Not Det, ND or nd
                        limit.
               NC =
                        Not Calculated
                        Volatile Organic Analysis
              VOA =
                        4-Bromofluorobenzene (an EPA 624 Surrogate)
              BFB =
           p-DFB = 1,4-Difluorobenzene (an EPA 624 Surrogate)
CLB-d5 = Chlorobenzene-d5 (an EPA 624 Surrogate)
                      2-Bromo-1-chloropropane (an EPA 601 Surrogate)
              BCP =
              TFT =
                      a,a,a-Trifluorotoluene (an EPA 602 Surrogate)
  Decachlorobiphenyl = (An EPA 608/8080 Surrogate)
```

#### **Definitions**

Surrogate Recovery = The recovery (expressed as a percent) of a non method analyte (see surrogates listed above) added to the sample for the purpose of monitoring system performance.

Matrix Spike Recovery = The recovery (expressed as a percent) of method analytes added to the sample for the purpose of determining any effect of sample composition on analyte recovery.

Laboratory Replicate = Two sample aliquots taken in the analytical laboratory and analyzed separately with identical procedures. Analyses of laboratory duplicates give a measure of the precision associated with laboratory procedures, but not with sample collection, preservation, or storage procedures.

Field Duplicate = Two separate samples collected at the same time and place under identical circumstances and treated exactly the same throughout field and laboratory procedures. Analysis of Field duplicates give a measure of the precision associated with sample collection, preservation and storage, as well as with laboratory procedures.

Relative Percent Difference (% RPD) = The precision measurement obtained on duplicate/replicate analyses. %RPD is calculated as:

%RPD = |value| - value2| * 100% ave. value



Massachusetts Certification M-MA 138 Connecticut Approval # PH 0777 Rhode Island # 98 & Maine # n/a New Hampshire ID#253893 New York ID#11393 Florida HRS87448

Environmental Remediation, Inc. 87 Church Street
East Hartford, CT 06108

August 1, 1996

Attn: J. Pearl

Client Project No.:

Location: Melville, NY

Lab ID No.	Client ID	Analysis Requested
AA57728	MW13D	C92-EPA 8010
AA57729	# 477 HP\$ 158	C91-EPA 601
AA57730	HP 7/58	C91-EPA 601
AA57731	<b>9 У</b> НР8/58	C91-EPA 601
AA57732	TRIPBLNK	C91-EPA 601

Authorized by

Hanibal Tayeh Presiden Laboratory Director

Laboratory Report

Client ID: MW13D-45 Lab ID No: **AA57379** 

Location: Melville Park Rd-Melville, NY

Client Job No.: 8930-96

Matrix: Soil Sampled on 07/23/96 by ERI Received on 07/24/96 by MD QC and Data Review by DDR

Preservative: Refrigeration Container: 1 Glass Soil Jar Condition of Sample as Received: Satisfactory Delivered by: Courier

Parameter	Result (in ug/Kg)	MDL	Extracted	Analyzed	Analyst
Bromodichloromethane	Not detected	20	07/25/96	07/29/96	NB
Bromoform	Not detected	20	07/25/96	07/29/96	NB
Bromomethane	Not detected	20	07/25/96	07/29/96	NB
Carbon tetrachloride	Not detected	20	07/25/96	07/29/96	NB
Chlorobenzene	Not detected	20	07/25/96	07/29/96	NB
Chloroethane	Not detected	20	07/25/96	07/29/96	NB
Chloroform	Not detected	20	07/25/96	07/29/96	NB
Chloromethane	Not detected	20	07/25/96	07/29/96	NB
Dibromochloromethane	Not detected	20	07/25/96	07/29/96	NB
1,2-Dichlorobenzene	Not detected	20	07/25/96	07/29/96	NB
1,3-Dichlorobenzene	Not detected	20	07/25/96	07/29/96	NB
1,4-Dichlorobenzene	Not detected	20	07/25/96	07/29/96	NB
Dichlorodifluoromethane	Not detected	20	07/25/96	07/29/96	NB
1,1-Dichloroethane	Not detected	20	07/25/96	07/29/96	NB
1,2-Dichloroethane	Not detected	20	07/25/96	07/29/96	NB
1,1-Dichloroethene	Not detected	20	07/25/96	07/29/96	NB
trans-1,2-Dichloroethene	Not detected  Not detected	20	07/25/96	07/29/96	NB
1,2-Dichloropropane	Not detected  Not detected	20	07/25/96	07/29/96	NB
cis-1,3-Dichloropropene	Not detected	20	07/25/96	07/29/96	NB
trans-1,3-Dichloropropene	Not detected  Not detected	20	07/25/96	07/29/96	NB
	Not detected  Not detected	50	07/25/96	07/29/96	NB
Methylene chloride	Not detected	20	07/25/96	07/29/96	NB
1,1,2,2-Tetrachloroethane	1,000	20	07/25/96	07/29/96	NB
Tetrachloroethene	Not detected	20	07/25/96	07/29/96	NB
1,1,1-Trichloroethane	Not detected  Not detected	20	07/25/96	07/29/96	NB
1,1,2-Trichloroethane	Not detected  Not detected	20	07/25/96	07/29/96	NB
Trichloroethene	Not detected Not detected	20	07/25/96	07/29/96	NB
Trichlorofluoromethane	Not detected Not detected	20	07/25/96	07/29/96	NB
Vinyl chloride	Not detected	20			
BCP Surrogate Recovery (%)	120		07/25/96	07/29/96	NB
% Solids	94.9	0.1	07/25/96	07/25/96	NB

Laboratory Report

Client ID: MW13D-62 Lab ID No: **AA57380** 

Location: Melville Park Rd-Melville, NY

Client Job No.: 8930-96

Matrix: Soil
Sampled on 07/23/96 by ERI
Received on 07/24/96 by MD
QC and Data Review by DDR

Preservative: Refrigeration Container: 1 Glass Soil Jar Condition of Sample as Received: Satisfactory Delivered by: Courier

Parameter	Result (in ug/Kg)	MDL	Extracted	Analyzed	Analyst
Bromodichloromethane	Not detected	20	07/25/96	07/29/96	NB
Bromoform	Not detected	20	07/25/96	07/29/96	NB
Bromomethane	Not detected	20	07/25/96	07/29/96	NB
Carbon tetrachloride	Not detected	20	07/25/96	07/29/96	NB
Chlorobenzene	Not detected	20	07/25/96	07/29/96	NB
Chloroethane	Not detected	20	07/25/96	07/29/96	NB
Chloroform	Not detected	20	07/25/96	07/29/96	NB
Chloromethane	Not detected	20	07/25/96	07/29/96	NB
Dibromochloromethane	Not detected	20	07/25/96	07/29/96	NB
1,2-Dichlorobenzene	Not detected	20	07/25/96	07/29/96	NB
1,3-Dichlorobenzene	Not detected	20	07/25/96	07/29/96	NB
1,4-Dichlorobenzene	Not detected	20	07/25/96	07/29/96	NB
Dichlorodifluoromethane	Not detected	20	07/25/96	07/29/96	NB
1,1-Dichloroethane	Not detected	20	07/25/96	07/29/96	NB
1,2-Dichloroethane	Not detected	20	07/25/96	07/29/96	NB
1,1-Dichloroethene	Not detected	20	07/25/96	07/29/96	NB
trans-1,2-Dichloroethene	Not detected	20	07/25/96	07/29/96	NB
1,2-Dichloropropane	Not detected	20	07/25/96	07/29/96	NB
cis-1,3-Dichloropropene	Not detected	20	07/25/96	07/29/96	NB
trans-1,3-Dichloropropene	Not detected	20	07/25/96	07/29/96	NB
Methylene chloride	Not detected	50	07/25/96	07/29/96	NB
1,1,2,2-Tetrachloroethane	Not detected	20	07/25/96	07/29/96	NB
Tetrachloroethene	200	20	07/25/96	07/29/96	NB
1,1,1-Trichloroethane	Not detected	20	07/25/96	07/29/96	NB
1,1,2-Trichloroethane	Not detected	20	07/25/96	07/29/96	NB
Trichloroethene	Not detected	20	07/25/96	07/29/96	NB
Trichlorofluoromethane	Not detected	20	07/25/96	07/29/96	NB
Vinyl chloride	Not detected	20	07/25/96	07/29/96	NB
BCP Surrogate Recovery (%)	92		07/25/96	07/29/96	NB
% Solids	75.3	0.1	07/25/96	07/25/96	NB

Laboratory Report

Client ID: MW13D-67 Lab ID No: AA57381

Location: Melville Park Rd-Melville, NY

Client Job No.: 8930-96

Matrix: Soil Sampled on 07/23/96 by ERI Received on 07/24/96 by MD QC and Data Review by DDR

Preservative: Refrigeration Container: 1 Glass Soil Jar Condition of Sample as Received: Satisfactory Delivered by: Courier

Parameter	Result (in ug/Kg)	MDL	Extracted	Analyzed	Analyst
Bromodichloromethane	Not detected	20	07/25/96	07/27/96	NB
Bromoform	Not detected	20	07/25/96	07/27/96	NB
Bromomethane	Not detected	20	07/25/96	07/27/96	NB
Carbon tetrachloride	Not detected	20	07/25/96	07/27/96	NB
Chlorobenzene	Not detected	20	07/25/96	07/27/96	NB
Chloroethane	Not detected	20	07/25/96	07/27/96	NB
Chloroform	Not detected	20	07/25/96	07/27/96	NB
Chloromethane	Not detected	20	07/25/96	07/27/96	NB
Dibromochloromethane	Not detected	20	07/25/96	07/27/96	NB
1,2-Dichlorobenzene	Not detected	20	07/25/96	07/27/96	NB
1,3-Dichlorobenzene	Not detected	20	07/25/96	07/27/96	NB
1,4-Dichlorobenzene	Not detected	20	07/25/96	07/27/96	NB
Dichlorodifluoromethane	Not detected	20	07/25/96	07/27/96	NB
1,1-Dichloroethane	Not detected	20	07/25/96	07/27/96	NB
1,2-Dichloroethane	Not detected	20	07/25/96	07/27/96	NB
1,1-Dichloroethene	Not detected	20	07/25/96	07/27/96	NB
trans-1,2-Dichloroethene	Not detected	20	07/25/96	07/27/96	NB
1,2-Dichloropropane	Not detected	20	07/25/96	07/27/96	NB
cis-1,3-Dichloropropene	Not detected	20	07/25/96	07/27/96	NB
trans-1,3-Dichloropropene	Not detected	20	07/25/96	07/27/96	NB
Methylene chloride	Not detected	50	07/25/96	07/27/96	NB
1,1,2,2-Tetrachloroethane	Not detected	20	07/25/96	07/27/96	NB
Tetrachloroethene	Not detected	40	07/25/96	07/27/96	NB
1,1,1-Trichloroethane	Not detected	20	07/25/96	07/27/96	NB
1,1,2-Trichloroethane	Not detected	20	07/25/96	07/27/96	NB
Trichloroethene	Not detected	20	07/25/96	<b>07/27/</b> 96	NB
Trichlorofluoromethane	Not detected	20	07/25/96	07/27/96	NB
Vinyl chloride	Not detected	20	07/25/96	07 <i>/</i> 27/96	NB
v myr emeride	• • • • • • • • • • • • • • • • • • • •				
BCP Surrogate Recovery (%)	92		07/25/96	07/27/96	NB
% Solids	85.1	0.1	07/25/96	07/25/96	NB

Laboratory Report

Client ID: MW13D Lab ID No: AA57728 Location: Melville, NY

Client Job No.:

Matrix: Soil Sampled on07/23/96 by ERI Received on 07/29/96 by DDR QC and Data Review by

Preservative: Refrigeration Container: 1-2oz Glass Soil Jar Condition of Sample as Received: Satisfactory Delivered by: Fed Ex

Parameter	Result (in ug/Kg)	MDL	Extracted	•	Analyst
Bromodichloromethane	Not detected	25	07/31/96	08/01/96	NB
Bromoform	Not detected	25	07/31/96	08/01/96	NB
Bromomethane	Not detected	25	07/31/96	08/01/96	NB
Carbon tetrachloride	Not detected	25	07/31/96	08/01/96	NB
Chlorobenzene	Not detected	25	07/31/96	08/01/96	NB
Chloroethane	Not detected	25	07/31/96	08/01/96	NB
Chloroform	Not detected	25	07/31/96	08/01/96	NB
Chloromethane	Not detected	25	07/31/96	08/01/96	NB
Dibromochloromethane	Not detected	25	07/31/96	08/01/96	NB
1,2-Dichlorobenzene	Not detected	25	07/31/96	08/01/96	NB
1,3-Dichlorobenzene	Not detected	25	07/31/96	08/01/96	NB
1,4-Dichlorobenzene	Not detected	25	07/31/96	08/01/96	NB
Dichlorodifluoromethane	Not detected	25	07/31/96	08/01/96	NB
1,1-Dichloroethane	Not detected	25	07/31/96	08/01/96	NB
1,2-Dichloroethane	Not detected	25	07/31/96	08/01/96	NB
1,1-Dichloroethene	Not detected	25	07/31/96	08/01/96	NB
trans-1,2-Dichloroethene	Not detected	25	07/31/96	08/01/96	NB
1,2-Dichloropropane	Not detected	25	07/31/96	08/01/96	NB
cis-1,3-Dichloropropene	Not detected	25	07/31/96	08/01/96	NB
trans-1,3-Dichloropropene	Not detected	25	07/31/96	08/01/96	NB
Methylene chloride	Not detected	62	07/31/96	08/01/96	NB
1,1,2,2-Tetrachloroethane	Not detected	25	07/31/96	08/01/96	NB
Tetrachloroethene	Not detected	25	07/31/96	08/01/96	NB
1,1,1-Trichloroethane	Not detected	25	07/31/96	08/01/96	NB
1,1,2-Trichloroethane	Not detected	25	07/31/96	08/01/96	NB
Trichloroethene	Not detected	25	07/31/96	08/01/96	NB
Trichlorofluoromethane	Not detected	25	07/31/96	08/01/96	NB
Vinyl chloride	Not detected	25	07/31/96	08/01/96	NB
BCP Surrogate Recovery (%)	90		07/31/96	08/01/96	NB
% Solids	85.3	0.1	07/31/96	07/31/96	NB

Laboratory Report

Client ID: HP5/58 Lab ID No: AA57729

Location: Melville, NY

Client Job No.:

Matrix: Water Sampled on 07/24/96 by ERI Received on 07/29/96 by DDR QC and Data Review by

Preservative: Refrigeration, HCl Container: 2 VOA Vials Condition of Sample as Received: Satisfactory Delivered by: Fed Ex

Parameter	Result (in ug/L)	MDL	Analyzed	Analyst
Bromodichloromethane	Not detected	2	08/01/96	NB
Bromoform	Not detected	2	08/01/96	NB
Bromomethane	Not detected	2	08/01/96	NB
Carbon tetrachloride	Not detected	2	08/01/96	NB
Chlorobenzene	Not detected	2	08/01/96	NB
Chloroethane	Not detected	10	08/01/96	NB
Chloroform	Not detected	2	08/01/96	NB
Chloromethane	Not detected	10	08/01/96	NB
Dibromochloromethane	Not detected	2	08/01/96	NB
1,2-Dichlorobenzene	Not detected	2	08/01/96	NB
1,3-Dichlorobenzene	Not detected	2	08/01/96	NB
1,4-Dichlorobenzene	Not detected	2	08/01/96	NB
Dichlorodifluoromethane	Not detected	2	08/01/96	NB
1,1-Dichloroethane	Not detected	2	08/01/96	NB
1,2-Dichloroethane	Not detected	2	08/01/96	NB
1,1-Dichloroethene	Not detected  Not detected	2	08/01/96	NB
trans-1,2-Dichloroethene	Not detected	2	08/01/96	NB
1,2-Dichloropropane	Not detected	2	08/01/96	NB
cis-1,3-Dichloropropene	Not detected	2	08/01/96	NB
trans-1,3-Dichloropropene	Not detected	2	08/01/96	NB
Methylene chloride	Not detected	5.0	08/01/96	NB
1,1,2,2-Tetrachloroethane	Not detected	2	08/01/96	NB
Tetrachloroethene	16	2	08/01/96	NB
1,1,1-Trichloroethane	Not detected	2	08/01/96	NB
1,1,2-Trichloroethane	Not detected	2	08/01/96	NB
Trichloroethene	Not detected	2	08/01/96	NB
Trichlorofluoromethane	Not detected	2	08/01/96	NB
Vinyl chloride	Not detected	2	08/01/96	NB
v myr omoriae				
BCP Surrogate Recovery (%)	112		08/01/96	NB

Laboratory Report

Client ID: HP7/58 Lab ID No: AA57730 Location: Melville, NY

Client Job No.:

Matrix: Water Sampled on 07/25/96 by ERI Received on 07/29/96 by DDR QC and Data Review by DDR

Preservative: Refrigeration, HCl Container: 2 VOA Vials Condition of Sample as Received: Satisfactory Delivered by: Fed Ex

Volatile I	Halocai	rbons
EPA Meth	ods 601 / 8	8010

Parameter	Result (in ug/L)	MDL	Analyzed	Analyst
Bromodichloromethane	Not detected	100000	08/01/96	NB
Bromoform	Not detected	100000	08/01/96	NB
Bromomethane	Not detected	100000	08/01/96	NB
Carbon tetrachloride	Not detected	100000	08/01/96	NB
Chlorobenzene	Not detected	100000	08/01/96	NB
Chloroethane	Not detected	500000	08/01/96	NB
Chloroform	Not detected	100000	08/01/96	NB
Chloromethane	Not detected	500000	08/01/96	NB
Dibromochloromethane	Not detected	100000	08/01/96	NB
1,2-Dichlorobenzene	Not detected	100000	08/01/96	NB
1,3-Dichlorobenzene	Not detected	100000	08/01/96	NB
1,4-Dichlorobenzene	Not detected	100000	08/01/96	NB
Dichlorodifluoromethane	Not detected	100000	08/01/96	NB
1,1-Dichloroethane	Not detected	100000	08/01/96	NB
1,2-Dichloroethane	Not detected	100000	08/01/96	NB
1,1-Dichloroethene	Not detected	100000	08/01/96	NB
trans-1,2-Dichloroethene	Not detected	100000	08/01/96	NB
1,2-Dichloropropane	Not detected	100000	08/01/96	NB
cis-1,3-Dichloropropene	Not detected	100000	08/01/96	NB
trans-1,3-Dichloropropene	Not detected	100000	08/01/96	NB
Methylene chloride	Not detected	250000.0	08/01/96	NB
1,1,2,2-Tetrachloroethane	Not detected	100000	08/01/96	NB
Tetrachloroethene	30,500,000	100000	08/01/96	NB
1,1,1-Trichloroethane	142,700	100000	08/01/96	NB
1,1,2-Trichloroethane	Not detected	100000	08/01/96	NB
Trichloroethene	498,300	100000	08/01/96	NB
Trichlorofluoromethane	Not detected	100000	08/01/96	NB
Vinyl chloride	Not detected	100000	08/01/96	NB
BCP Surrogate Recovery (%)	103		08/01/96	NB

Laboratory Report

Client ID: HP\$/58 Lab ID No: AA57731

Location: Melville, NY

Client Job No.:

Matrix: Water Sampled on 07/26/96 by ERI Received on 07/29/96 by DDR QC and Data Review by DDR

Preservative: Refrigeration, HCl Container: 2 VOA Vials Condition of Sample as Received: Satisfactory Delivered by: Fed Ex

<b>.</b>	D ===14 (i====#)	MDL	Analyzed	Analyst
Parameter	Result (in ug/L)		08/01/96	NB
Bromodichloromethane	Not detected	500	08/01/96	NB
Bromoform	Not detected	500	08/01/96	NB NB
Bromomethane	Not detected	500		NB
Carbon tetrachloride	Not detected	500	08/01/96	
Chlorobenzene	Not detected	500	08/01/96	NB
Chloroethane	Not detected	2500	08/01/96	NB
Chloroform	Not detected	500	08/01/96	NB
Chloromethane	Not detected	2500	08/01/96	NB
Dibromochloromethane	Not detected	500	08/01/96	NB
1,2-Dichlorobenzene	Not detected	500	08/01/96	NB
1,3-Dichlorobenzene	Not detected	500	08/01/96	NB
1,4-Dichlorobenzene	Not detected	500	08/01/96	NB
Dichlorodifluoromethane	Not detected	500	08/01/96	NB
1,1-Dichloroethane	Not detected	500	08/01/96	NB
1,2-Dichloroethane	Not detected	500	08/01/96	NB
1,1-Dichloroethene	Not detected	500	08/01/96	NB
trans-1,2-Dichloroethene	Not detected	500	08/01/96	NB
1,2-Dichloropropane	Not detected	500	08/01/96	NB
cis-1,3-Dichloropropene	Not detected	500	08/01/96	NB
trans-1,3-Dichloropropene	Not detected	500	08/01/96	NB
Methylene chloride	Not detected	1250.0	08/01/96	NB
1,1,2,2-Tetrachloroethane	Not detected	500	08/01/96	NB
Tetrachloroethene	122,100	500	08/01/96	NB
1,1,1-Trichloroethane	1,400	500	08/01/96	NB
1,1,2-Trichloroethane	Not detected	500	08/01/96	NB
Trichloroethene	6,400	500	08/01/96	NB
Trichlorofluoromethane	Not detected	500	08/01/96	NB
Vinyl chloride	Not detected	500	08/01/96	NB
BCP Surrogate Recovery (%)	99		08/01/96	NB

Laboratory Report

Client ID: TRIPBLNK Lab ID No: AA57732

Location: Melville, NY

Client Job No.:

Matrix: Water Sampled on07/19/96 by ERI Received on 07/29/96 by DDR QC and Data Review by

Preservative: Refrigeration, HCl Container: 1 VOA Vial Condition of Sample as Received: Satisfactory Delivered by: Fed Ex

	DA 12 Inchiods col /	3010		
Parameter	Result (in ug/L)	MDL	Analyzed	Analyst
Bromodichloromethane	Not detected	1	07/31/96	NB
Bromoform	Not detected	1	07/31/96	NB
Bromomethane	Not detected	1	07/31/96	NB
Carbon tetrachloride	Not detected	1	07/31/96	NB
Chlorobenzene	Not detected	1	07/31/96	NB
Chloroethane	Not detected	5	07/31/96	NB
Chloroform	Not detected	1	07/31/96	NB
Chloromethane	Not detected	5	07/31/96	NB
Dibromochloromethane	Not detected	1	07/31/96	NB
1,2-Dichlorobenzene	Not detected	1	07/31/96	NB
1,3-Dichlorobenzene	Not detected	1	07/31/96	NB
1,4-Dichlorobenzene	Not detected	1	07/31/96	NB
Dichlorodifluoromethane	Not detected	1	07/31/96	NB
1,1-Dichloroethane	Not detected	1	07/31/96	NB
1,2-Dichloroethane	Not detected	1	07/31/96	NB
1,1-Dichloroethene	Not detected	1	07/31/96	NB
trans-1,2-Dichloroethene	Not detected	1	07/31/96	NB
1,2-Dichloropropane	Not detected	1	07/31/96	NB
cis-1,3-Dichloropropene	Not detected	1	07/31/96	NB
trans-1,3-Dichloropropene	Not detected	1	07/31/96	NB
Methylene chloride	Not detected	2.5	07/31/96	NB
1,1,2,2-Tetrachloroethane	Not detected	1	07/31/96	NB
Tetrachloroethene	Not detected	1	07/31/96	NB
1,1,1-Trichloroethane	Not detected	1	07/31/96	NB
1,1,2-Trichloroethane	Not detected	1	07/31/96	NB
Trichloroethene	Not detected	1	07/31/96	NB
Trichlorofluoromethane	Not detected	1	07/31/96	NB
Vinyl chloride	Not detected	1	07/31/96	NB
BCP Surrogate Recovery (%)	88		07/31/96	NB

## Spectrum Analytical, Inc. Laboratory Report Supplement

#### References

Methods for the Determination of Organic Compounds in Drinking Water. EPA-600/4-88/039. EMSL 1988.

Methods for Chemical Analysis of Water and Wastes. EPA 600/4-79-020. EMSL 1983.

Methods for Organic Chemical Analysis of Municipal and Industrial Wastewater. EPA 600/4-82-057. EMSL 1982.

Test Methods for Evaluating Solid Waste. Physical/Chemical Methods. EPA SW-846. 1986.

Standard Methods for the Examination of Water and Wastes, APHA-AWWA-WPCF. 16th Edition. 1985.

Standard Methods for Comparison of Waterborne Petroleum Oils by Gas Chromatography. ASTM D 3328. 1982.

Oil Spill Identification System. U.S. Coast Guard CG-D-52-77. 1977.

Handbook for Analytical Quality Control in Water and Wastewater Laboratories. EPA 600/4-79-019. EMSL 1979.

Choosing Cost-Effective QA/QC (Quality Assurance/Quality Control) Programs for Chemical Analyses. EPA 600/4-85/056. EMSL 1985.

#### Report Notations

```
Not Detected,
                       The compound was not detected at a concentration
Not Det, ND or nd
                      equal to or above the established method detection
                      limit.
              NC =
                      Not Calculated
             VOA =
                      Volatile Organic Analysis
                      4-Bromofluorobenzene (an EPA 624 Surrogate)
             BFB =
                      1,4-Difluorobenzene
                                              (an EPA 624 Surrogate)
           p-DFB =
                      Chlorobenzene-d5 (an EPA 624 Surrogate)
          CLB-d5 =
                      2-Bromo-1-chloropropane (an EPA 601 Surrogate)
             BCP =
             TFT
                      a, a, a-Trifluorotoluene (an EPA 602 Surrogate)
                      (An EPA 608/8080 Surrogate)
  Decachlorobiphenyl =
```

#### **Definitions**

Surrogate Recovery = The recovery (expressed as a percent) of a non method analyte (see surrogates listed above) added to the sample for the purpose of monitoring system performance.

Matrix Spike Recovery = The recovery (expressed as a percent) of method analytes added to the sample for the purpose of determining any effect of sample composition on analyte recovery.

Laboratory Replicate = Two sample aliquots taken in the analytical laboratory and analyzed separately with identical procedures. Analyses of laboratory duplicates give a measure of the precision associated with laboratory procedures, but not with sample collection, preservation, or storage procedures.

Field Duplicate = Two separate samples collected at the same time and place under identical circumstances and treated exactly the same throughout field and laboratory procedures. Analysis of Field duplicates give a measure of the precision associated with sample collection, preservation and storage, as well as with laboratory procedures.

Relative Percent Difference (% RPD) = The precision measurement obtained on duplicate/replicate analyses. %RPD is calculated as:

```
%RPD = <u>[value1 - value2]</u> * 100% ave. value
```

Laboratory Report

Client ID: MW16D-61 Lab ID No: AA57376

Location: Melville Park Rd-Melville, NY

Client Job No.: 8930-96

Matrix: Water
Sampled on 07/22/96 by ERI
Received on 07/24/96 by MD
QC and Data Review by DDR

Preservative: Refrigeration
Container: 2 VOA Vials
Condition of Sample as Received: Satisfactory
Delivered by: Courier

Volatile	Halocarbons
EPA Met	thods 601 / 8010

Parameter	Result (in ug/L)	MDL	Analyzed	Analyst
Bromodichloromethane	Not detected	5	07/29/96	CH
Bromoform	Not detected	5	07/29/96	CH
Bromomethane	Not detected	5	07/29/96	CH
Carbon tetrachloride	Not detected	5	07/29/96	CH
Chlorobenzene	Not detected	5	07/29/96	CH
Chloroethane	Not detected	25	07/29/96	CH
Chloroform	Not detected	5	07/29/96	CH
Chloromethane	Not detected	25	07/29/96	CH
Dibromochloromethane	Not detected	5	07/29/96	CH
1,2-Dichlorobenzene	Not detected	5	07/29/96	CH
1,3-Dichlorobenzene	Not detected	5	07/29/96	CH
1,4-Dichlorobenzene	Not detected	5	07/29/96	CH
Dichlorodifluoromethane	Not detected	5	07/29/96	CH
1,1-Dichloroethane	6.2	5	07/29/96	CH
1,2-Dichloroethane	Not detected	5	07/29/96	CH
1,1-Dichloroethene	Not detected	5	07/29/96	CH
trans-1,2-Dichloroethene	Not detected	5	07/29/96	CH
1,2-Dichloropropane	Not detected	5	07/29/96	CH
cis-1,3-Dichloropropene	Not detected	5	07/29/96	CH
trans-1,3-Dichloropropene	Not detected	5	07/29/96	CH
Methylene chloride	Not detected	12.5	07/29/96	CH
1,1,2,2-Tetrachloroethane	Not detected	5	07/29/96	CH
Tetrachloroethene	300	5	07/29/96	CH
1,1,1-Trichloroethane	20	5	07/29/96	CH
1,1,2-Trichloroethane	Not detected	5	07/29/96	CH
Trichloroethene	45	5	07/29/96	CH
Trichlorofluoromethane	Not detected	5	07/29/96	CH
Vinyl chloride	Not detected	5	07/29/96	CH
BCP Surrogate Recovery (%)	103		07/29/96	CH

Laboratory Report

Client ID: MW16D-76 Lab ID No: AA57377

Location: Melville Park Rd-Melville, NY

Client Job No.: 8930-96

Matrix: Water
Sampled on 07/22/96 by ERI
Received on 07/24/96 by MD
QC and Data Review by DDR

Preservative: Refrigeration Container: 2 VOA Vials Condition of Sample as Received: Satisfactory Delivered by: Courier

Volatile Halocarbons
EPA Methods 601 / 8010

	El A Memors out /	0010		
Parameter	Result (in ug/L)	MDL	Analyzed	<b>Analyst</b>
Bromodichloromethane	Not detected	1	07/29/96	CH
Bromoform	Not detected	1	07/29/96	CH
Bromomethane	Not detected	1	07/29/96	CH
Carbon tetrachloride	Not detected	1	07/29/96	CH
Chlorobenzene	Not detected	1	07/29/96	CH
Chloroethane	Not detected	5	07/29/96	CH
Chloroform	Not detected	1	07/29/96	CH
Chloromethane	Not detected	5	07/29/96	CH
Dibromochloromethane	Not detected	1	07/29/96	CH
1,2-Dichlorobenzene	Not detected	1	07/29/96	CH
1,3-Dichlorobenzene	Not detected	1	07/29/96	CH
1,4-Dichlorobenzene	Not detected	1	07/29/96	CH
Dichlorodifluoromethane	Not detected	1	07/29/96	CH
1,1-Dichloroethane	Not detected	1	07/29/96	CH
1,2-Dichloroethane	Not detected	1	07/29/96	CH
1,1-Dichloroethene	Not detected	1	07/29/96	CH
trans-1,2-Dichloroethene	Not detected	1	07/29/96	CH
1,2-Dichloropropane	Not detected	1	07/29/96	CH
cis-1,3-Dichloropropene	Not detected	1	07/29/96	CH
trans-1,3-Dichloropropene	Not detected	1	07/29/96	CH
Methylene chloride	Not detected	2.5	07/29/96	CH
1,1,2,2-Tetrachloroethane	Not detected	1	07/29/96	CH
Tetrachloroethene	9,800	100	07/29/96	CH
1,1,1-Trichloroethane	30	1	07/29/96	CH
1,1,2-Trichloroethane	Not detected	1	07/29/96	CH
Trichloroethene	100	1	07/29/96	CH
Trichlorofluoromethane	Not detected	1	07/29/96	CH
Vinyl chloride	Not detected	1	07 <i>/</i> 29/96	CH
BCP Surrogate Recovery (%)	113		07/29/96	СН
DCI Buildgate Recovery (70)				

Laboratory Report

Client ID: MW16D-86 Lab ID No: AA57378

Location: Melville Park Rd-Melville, NY

Client Job No.: 8930-96

Matrix: Water Sampled on 07/22/96 by ERI Received on 07/24/96 by MD QC and Data Review by DDR

Preservative: Refrigeration Container: 2 VOA Vials Condition of Sample as Received: Satisfactory Delivered by: Courier

Volatile	Halocarbons
FPA Met	hods 601 / 8010

Parameter	Result (in ug/L)	MDL	Analyzed	Analyst
Bromodichloromethane	Not detected	2	07/29/96	NB
Bromoform	Not detected	2	07/29/96	NB
Bromomethane	Not detected	2	07/29/96	NB
Carbon tetrachloride	Not detected	2	07/29/96	NB
Chlorobenzene	Not detected	2	07/29/96	NB
Chloroethane	Not detected	10	07/29/96	NB
Chloroform	Not detected	2	07/29/96	NB
Chloromethane	Not detected	10	07/29/96	NB
Dibromochloromethane	Not detected	2	07/29/96	NB
1,2-Dichlorobenzene	Not detected	2	07/29/96	NB
1,3-Dichlorobenzene	Not detected	2	07/29/96	NB
1,4-Dichlorobenzene	Not detected	2	07/29/96	NB
Dichlorodifluoromethane	Not detected	2	07/29/96	NB
1,1-Dichloroethane	Not detected	2	07/29/96	NB
1,2-Dichloroethane	Not detected	2	07/29/96	NB
1,1-Dichloroethene	Not detected	2	07/29/96	NB
trans-1,2-Dichloroethene	Not detected	2	07/29/96	NB
1,2-Dichloropropane	Not detected	2	07/29/96	NB
cis-1,3-Dichloropropene	Not detected	2	07/29/96	NB
trans-1,3-Dichloropropene	Not detected	2	07/29/96	NB
Methylene chloride	Not detected	5.0	07/29/96	NB
1,1,2,2-Tetrachloroethane	Not detected	2	07/29/96	NB
Tetrachloroethene	2,600	100	07/29/96	NB
1,1,1-Trichloroethane	4.1	2	07/29/96	NB
1,1,2-Trichloroethane	Not detected	2	07/29/96	NB
Trichloroethene	24	2	07/29/96	NB
Trichlorofluoromethane	Not detected	2	07/29/96	NB
Vinyl chloride	Not detected	2	07/29/96	NB
BCP Surrogate Recovery (%)	102		07/29/96	NB

## Spectrum Analytical, Inc. Laboratory Report Supplement

#### References

Methods for the Determination of Organic Compounds in Drinking Water. EPA-600/4-88/039. EMSL 1988.

Methods for Chemical Analysis of Water and Wastes. EPA 600/4-79-020. EMSL 1983.

Methods for Organic Chemical Analysis of Municipal and Industrial Wastewater. EPA 600/4-82-057. EMSL 1982.

Test Methods for Evaluating Solid Waste. Physical/Chemical Methods. EPA SW-846. 1986.

Standard Methods for the Examination of Water and Wastes. APHA-AWWA-WPCF. 16th Edition. 1985.

Standard Methods for Comparison of Waterborne Petroleum Oils by Gas Chromatography. ASTM D 3328. 1982.

Oil Spill Identification System. U.S. Coast Guard CG-D-52-77. 1977.

Handbook for Analytical Quality Control in Water and Wastewater Laboratories. EPA 600/4-79-019, EMSL 1979.

Choosing Cost-Effective QA/QC (Quality Assurance/Quality Control) Programs for Chemical Analyses. EPA 600/4-85/056. EMSL 1985.

#### Report Notations

```
Not Detected,
                         The compound was not detected at a concentration
Not Det, ND or nd
                         equal to or above the established method detection
                         limit.
                         Not Calculated
                NC =
               VOA =
                         Volatile Organic Analysis
                         4-Bromofluorobenzene (an EPA 624 Surrogate)
               BFB =
                        1,4-Difluorobenzene (an EPA 624 Surrogate)
Chlorobenzene-d5 (an EPA 624 Surrogate)
             p-DFB =
            CLB-d5 =
               BCP =
                        2-Bromo-1-chloropropane (an EPA 601 Surrogate)
               TFT =
                        a, a, a-Trifluorotoluene (an EPA 602 Surrogate)
  Decachlorobiphenyl = (An EPA 608/8080 Surrogate)
```

#### **Definitions**

Surrogate Recovery = The recovery (expressed as a percent) of a non method analyte (see surrogates listed above) added to the sample for the purpose of monitoring system performance.

Matrix Spike Recovery = The recovery (expressed as a percent) of method analytes added to the sample for the purpose of determining any effect of sample composition on analyte recovery.

Laboratory Replicate = Two sample aliquots taken in the analytical laboratory and analyzed separately with identical procedures. Analyses of laboratory duplicates give a measure of the precision associated with laboratory procedures, but not with sample collection, preservation, or storage procedures.

Field Duplicate = Two separate samples collected at the same time and place under identical circumstances and treated exactly the same throughout field and laboratory procedures. Analysis of Field duplicates give a measure of the precision associated with sample collection, preservation and storage, as well as with laboratory procedures.

Relative Percent Difference (% RPD) = The precision measurement obtained on duplicate/replicate analyses. %RPD is calculated as:

%RPD = |value1 - value2| * 100%ave. value

# GROUNDWATER ANALYTICAL SUMMARY PHASE II (July, 1996) 25 MELVILLE PARK ROAD MELVILLE, NEW YORK All Units in ug/L

1.2 dictionettiene	CIN	QN	CIN	CIN		Q	QN	CIN	ON.	ON		5
1, l. dichiatoritene	QN	QN	QN	ND		ND	NID	CIN	CIN	ND		5
1.1.1 ok bloroedsins	Q.	2.9	4.1	30		20	8,9	QN	142,700	1,400		5
Tr. M. Ger Genthane	008'S	8.6	<b>≯</b> 2	100		4.5	3.1	QN	498,300	6,400		S
tetrachloxyethere		1,200	2,600	9,800		300	2.1	91	30,500,000	122,100		5
	MW-13D	MW-16D*	MW-16D @ 86'	MW-16D @ 76'	MW-16D @	01.***	MW-17**	HP7 @ 58'	HP8/P1 @ 58'	HP9/VES1 @ 58'	NYSDEC WQ	Standard

ND - Not Detected above the analytical detection limit Bold number denotes equal to or above the NYSDEC WQ Standard.

Samples analyzed via Method 8010

* Chloroform @ 41 ug/L and bromodichforomethane @ 1.8 ug/L were detected in MW-16D.

** Chloromethane @ 1.9 ug/L and 1,2-dichloroethane @ 6.9 ug/L were detected in MW-17.

*** 1,1-dichloroethane @ 6.2 ug/L was detected in MW-16D-61

CLIENT: ERI

PROJECT NAME: 25 MELVILLE PARK

LOCATION: MELVILLE, NY

DRILLER: S. Ramsdell

INSPECTOR J. Pearl

DATE START: 7-25-96

#### NEW ENGLAND BORING CONTRACTORS OF CT., INC.



129 KRIEGER LANE GLASTONBURY, CT 06033 (203) 633-4649 -- (413) 733-1232 FAX (203) 657-8046

Core Berrel

Casing Sampter TYPE HSA SS SIZE I.D. 4-1/4" 1-3/8" HAMMER WT. 140 HAMMER FALL 30"

BORING No. HP-7

SHEET 1 OF 1

ARCHITECT! ENGINEER

FILE NO ERIMELVI

SURFACE ELEV.

DATE	INISH 7-25						MINIER PALL		OFFSE	7	
		_	MPLE	250 41	_		CASING BLOWS/ CORING				
No.	DEPTH RANGE IN FEET	0.8	BLOWS ON SAI	12-18	18-24	REC.	CORING TIMES PER FT	FIELD CLASSIFICATION AND REMARKS		Cone.	Installation Details
								Blacktop Processed Gravel Light Brown Fine - Crs. Sand and Fine - Med. Gravel	. ₍ 1		Roadway Box 30° of 2° PVC Riser
						-					5° Bentonite Chip Seal
										a fortimentation	10' of .010 Slot 2" PVC Screen NJ #2 Sand
S1	45°.47°	18	20	29	29	12"		Light Brown Fine - Crs. Sand and Fine - Crs. Gravel, Few Cobbles	45	<b>(1)</b>	Bottom of Well
									58		
NOTES:	1) The stratificati approximate a types, Transfr		ween and	in the condi- fluetu water then t	drift holes Uane state Jakena in May mocu	Sings have to set remote a dion the Bo the lavus o due to fact ent at the se nede	and complex oring logs of ground- tore other	End of Boring @ 58', Water @ 50' +/- REMARKS: Hydro-punch @ 58'			•

#### CLIENT ERI

PROJECT NAME: 25 MELVILLE PARK

LOCATION: MELVILLE, NY

ORILLER S. Ramsdell

INSPECTOR: J. Pearl

DATE START: 7-25-96

#### NEW ENGLAND BORING CONTRACTORS OF CT., INC.



TYPE SIZE I.D.

HAMMER WT.

HAMMER FALL

129 KRIEGER LANE GLASTONBURY, CT 06033 (203) 633-4649 -- (413) 733-1232 FAX (203) 657-8046

Caeina HSA 4-1/4 Sampler Core Barrel

**BORING No. HP-8** 

SHEET 1 OF 1

ARCHITECT/ ENGINEER

FILE NO. ERIMELVI

SURFACE ELEV.

DATE FINISH	7-26-96						OFFSE	т	
No. RA	SA EPTH NGE FEET 0-6	BLOWS ON SAN	PER 6" MPLER 12-18 18-24	REC.	CASING BLOWS/ CORING TIMES PER FT.	FIELD CLASSIFICATION AND REMARKS		Woll Con≢.	inataliation Dotails
						End of Boring @ 58", Water @ 50" REMARKS: Hydro-punch @ 58"			Roadway Box 30' of 3" PVC Riser 13' Bentonite Chip Seal  10' of .020 Slot 3" PVC Screen NJ #2 Sand  Bottom of Well @ 40'
	he etretification unds seratumeta besondery pas, Transifiche may	between seri	2) Water lovel near in the drill hole Candillond state fluctuations in water may adout then three gree underdants were	ed or runned a bud on the br the level of ur due to fac- dont at the t	tase other of grands- ared leds ared misses	TEMARKS: TIYUTU-PUTICIL W 30			

CLIENT: ERI

PROJECT NAME: 25 MELVILLE PARK

LOCATION. MELVILLE, NY

DRILLER. S. Ramsdell

INSPECTOR: J. Pearl

DATE START: 7-23-96

DATE FINISH: 7-24-96

#### NEW ENGLAND BORING CONTRACTORS OF CT., INC.



HAMMER FALL

129 KRIEGER LANE GLASTONBURY, CT 06033 (203) 633-4849 -- (413) 733-1232 FAX (203) 657-8046

Casing Sc TYPE HSA SIZE I.O. 4-1/4" 1 HAMMER WT.

Sampler Core Barrel SS

1-3/8" 140 30" BORING No. MW-13D

SHEET 1 OF 2

ARCHITECT/ ENGINEER

FILE NO. ERIMELVI

SURFACE ELEV

LINE & STATION

DATE	FINISH: 7 - 24		MPLE				LCASING	OFFS	<u> </u>	<u> </u>
	DEPTH	T 3A	BLOWS	PER 6		· · ·	CASING BLOWS/	SITE O OF A CONTICA TION AND BENADES	Well	Installation
No	RANGE IN FEET		ON SA	MPLER		REC.	CORING TIMES PER FT	FIELD CLASSIFICATION AND REMARKS	Cons	Dateils
	IN FEET	0.6	6-12	12-13	18-24		PER FT		-	<u> </u>
								Blacktop		Roadway Box
								Cancrete		80" of 2" PVC
							Ì	.3	12 0	Riser
		1				[		Light Brown Fine - Med. Gravel and Med Crs. Sand, Little Fine Sand	12 12	
								Gard, Ettila i ilia Gard	121 121	
		1							10 10	
								Little Crs. Gravel @ 43*	12 12	
							1		12/2	
							1		$\mathbb{Z}$	
									13 13	
									22	
		]					]		12 2	
							-			
									12 12	
									12 14	
									12 2	
						ļ				
						ł				
							<u> </u>			
		ļ								
SI	4045.	15	17	17	19	10"			10 B	
		ł								
<b>S</b> 2	45'-47'	17	31	42	29	10"		•		
32	43 .47	''	٥,	42	29	'0				
		ĺ								
								50	MA	
S 3	50'-52'	13	16	26	34	12"		White - Light Brown Fine - Crs. Sand, Little	100	
		1						Fine Gravel		
							1			
<b>S4</b>	55 ⁻ -57 ⁻	3	11	18	23	24-			周周	20° Bentanite
		1		_		-	-			Chip Seal
NOTES	*) The stressucces		present the	2) was	ar leves rad	efings have	tippe mane	REMARKS:	154 53	
	dour garrenta di Lyper - Yearasi		HOR SOM	in th	o erit hate Miere state	e of the b	and under oring ings			
				wate	may aud	the lovel of shorts to tak work at the t	Clare of the			
				-	-	made.				

CLIENT ERI

PROJECT NAME: 25 MELVILLE PARK

LOCATION MELVILLE, NY

DRILLER: S. Ramsdell

INSPECTOR J. Pearl

DATE START: 7-23-96

DATE FINISH: 7-24-96

#### NEW ENGLAND BORING CONTRACTORS OF CT., INC.



129 KRIEGER LANE GLASTONBURY, CT 06033 (203) 633-4649 -- (413) 733-1232 FAX (203) 657-8046

TYPE S:ZE I.D. HAMMER WT. HAMMER FALL

Casing Sampler Core Barret
HSA SS
4-1/4" 1-3/8"

140 30" BORING No. MW-13D

SHEET 2 OF 2

ARCHITECT/ ENGINEER

FILE NO. ERIMELVI

SURFACE ELEV

LINE & STATION

Ì				MPLE				CASING	] 0.110		
ľ	No.	DEPTH RANGE IN FEET		BLOWS ON SA	S PER 6" MPLER		REC.	CASING BLOWS/ CORING TIMES	FIELD CLASSIFICATION AND REMARKS	Weil Cons.	Installation Dotails
ŀ		IN FEET	0-6	6-12	12-18	18-24		PER FT.	60		
	<b>S</b> \$	60'- <b>62'</b>	4	10	13	30	24~		White - Light Brown Fine - Med. Sand		
	\$6	65'-67'	7	11	17	19	18*		Light Brown Fine - Med. Sand, Occ. Lenses of Silty Clay		
	\$7	70'-72'	21	29	43	52	24"			ONEDARIO DE COMPONIO DE CO	į
	ss	75'-77'	No	Blow	Count		24-				
											10' of .010 Slot 2" PVC Screen
										i in	NJ #2 Sand
									End of Boring @ 90" Water @ 50"		Buttorn of Well
			:								
										,	

CLIENT ERI

PROJECT NAME: 25 MELVILLE PARK

LOCATION: MELVILLE, NY

DRILLER: S. Ramsdell

INSPECTOR J. Pearl

DATE START: 7-22-96

DATE FINISH: 7-23-96

NEW ENGLAND BORING CONTRACTORS OF CT., INC.



129 KRIEGER LANE GLASTONBURY, CT 06033 (203) 833-4649 ·· (413) 733-1232 FAX (203) 857-8048

TYPE HSA
SIZE I.O. 4-1/4"
HAMMER WT.
HAMMER FALL

Casing Sampler HSA SS

SS 1-3/8" 140 30" Core Barrel

BORING No. MW-16D

SHEET 1 OF 2

ARCHITECT/ ENGINEER

FILE NO. ERIMELVI

SURFACE ELEV

LINE & STATION

ACCEC

DATE F	INISH 7-23								OFFSET	
			MPLE	nen e:		_	CASING   BLOWS/		Well	(aaII.asia.a
No	DEPTH RANGE IN FEET	0.6		PER 6"		REC.	CASING BLOWS/ CORING TIMES PER FT	FIELD CLASSIFICATION AND REMARKS	Cons.	Installation Details
		0.6	0.12_	1 (2-18	18.24		PEKPI	Blacktop	20	Roadway Box
								Light Brown Med Crs. Sand and Fine - Med. Gravel		79" of 2" PVC Riser
						}				
S1	2055.	9	11	12	17	11"				
										2' Bentonite Crup Seal
\$2	401-421	14	14	24	20	12"				
NOTES:	The stratifical reprosumers to types Trans	hours between	tween tree	in ti asa filo that	ne And Anie ditions state dustinus in at may opin	dings have a 41 times in ad an the b the ignal or due to les and at the i	and under dring lage of ground ctors ather	REMARKS. Hydro-punch @ 60', 75', 90'	Here Jere	

CLIENT: ERI

PROJECT NAME: 25 MELVILLE PARK

LOCATION MELVILLE, NY

DRILLER S. Ramsdell

INSPECTOR: J. Pearl

DATE START: 7-22-96

#### NEW ENGLAND BORING CONTRACTORS OF CT., INC.



129 KRIEGER LANE GLASTONBURY, CT 06033 (203) 633-4649 -- (413) 733-1232 FAX (203) 657-8046

Casing Sampler Core Barrel HSA 4-1/4" TYPE SS 1-3/8" SIZE I.D. HAMMER WT. 140 HAMMER FALL 30BORING No. MW-16D

SHEET 2 OF 2

ARCHITECT/ ENGINEER

FILE NO. ERIMELVI

SURFACE ELEV

DAIL	FINISH: 7-2			NMEN PALL		OFFSE	T	
	0.0711	SAMPLE	Ι	CASING BLOWS/			Well	loet all arion
No.	DEPTH RANGE IN FEET	PLOWS PER 6" ON SAMPLER  0-6 6-12 12-18 18-24	REC.	CASING 8LOWS/ CORING TIMES PER FT.	FIELD CLASSIFICATION AND REMARKS		Cons.	Installation Details
		0.0 0.12 12.18 18.24		PER FI.				
				<u> </u>				
			1					
			1					
			i					
			ļ					
								10" of .010 Slot 2" PVC
							:雷:	Screen
		1					[:書:	NJ #2 Sand
				]				
		†					:書:	
			-		<u> </u>	30		Battam of W
					End of Boring @ 90' Water @ 55'			(න 8∂.
		+						
		1	}	ŀ				
			}	ļ				
		<u></u>						

CLIENT ERI

PROJECT NAME: 25 MELVILLE PARK

LOCATION MELVILLE, NY

DRILLER S. Ramadall

INSPECTOR: J. Pearl

DATE START 7-24-96

DATE FINISH: 7-24-96

NEW ENGLAND BORING CONTRACTORS OF CT., INC.



129 KRIEGER LANE GLASTONBURY, CT 06033 (203) 633-4649 -- (413) 733-1232 FAX (203) 657-8046

Casing
TYPE HSA
SIZE I.D. 4-1/4"
HAMMER W.T.

HAMMER FALL

ng Sampler A SS 4" 1-3/8" 140 30" Cora Sarral

BORING No. MW-17

SHEET 1 OF 2

ARCHITECT/ ENGINEER

FILE NO. ERIMELVI

SURFACE ELEV.

LINE & STATION

SAMPLE							CASING	OFFSE		f
No.	DEPTH RANGE IN FEET		BLOWS ON SA	MPLER		REC.	BLOWS/ CORING TIMES	FIELD CLASSIFICATION AND REMARKS	Well Cons	Installation Details
	IN FEET	0-8	8-12	12-18	18-24		PER FT.			
		1						Blacktop	PA PA	Roadway Box
								Road Base		50' of 2" PVC
										Riser
								Light Brown Fine - Mcd. Gravel and Med Crs. Sand		
		İ				İ	[		KA KA	
						1				
		!				i				
									1212	
								Few Cobbles @ 45'		
									98	
		l							B B	
}									KA KA	
									KIK	
						]				
									00	
ł		l				İ				
		1						I	2	
									8	
]						ŀ				
- 1										
									88	
S1	4045.	10	11	12	10	3-				
									1212	
						İ			1919	
S2	45.47	8	12	31	100	14"				
										2° Bentonite
							İ .			Chip Seal
S3	50'-52"	13	13	14	16	10-				
-	30 32	'3	. 3	, ~	· u	'			:量:	10" of .010 Slot 2" PVC
						ŀ			:量:	Screen
							}	ss	: ] :	NJ #2 Sand
54	5557.	5	10	20	27	24-		Brown - Orange Brown Fine - Med. Sand, Trace of	: ]	
								Fine Gravel	:書:	
OTES:	1) The stratificati						L	DCMADV C.	·Ħ:	
	epprominate a types Transf			•••	he and half	dings have to set times a don the be	and under	REMARKS:		
					-	**************************************	of ground-			

CLIENT ERI

PROJECT NAME: 25 MELVILLE PARK

LOCATION: MELVILLE, NY

DRILLER: S. Ramsdell

INSPECTOR J. Pearl

DATE START: 7-24-96

DATE FINISH: 7 - 24 - 96

#### NEW ENGLAND BORING CONTRACTORS OF CT., INC.



129 KRIEGER LANE GLASTONBURY, CT 00033 (203) 633-4649 -- (413) 733-1232 FAX (203) 657-8046

Core Barrel

TYPE SIZE I.C. HAMMER WT. HAMMER FALL Casing Sampler HSA SS 4-1/4" 1-3/8" 140 30" BORING No. MW-17

SHEET 2 OF 2

ARCHITECT/ ENGINEER

FILE NO ERIMELVI

SURFACE ELEV.

LINE & STATION

		ŞA	MPLE				CASING		l	
No	DEPTH RANGE IN FEET	1	BLOWS ON SA	PER 6"		REC.	CASING BLOWS/ CORING TIMES PER FT.	FIELD CLASSIFICATION AND REMARKS	Walt Cons.	Installation Details
140	IN FEET	0-6	8-12	12-18	18-24	AEC.	PER FT.		1	5505
<b>\$</b> 5	60'-62'	5	9	14	33	24"		Light Brown Fine Mcd. Sand w/ Occ. Layers of Silty Clay		Bottam of We @ 60'
		İ						End of Boring @ 65' Water @ 52' +/-		

CLIENT: ERI

PROJECT NAME: 25 MELVILLE PARK

LOCATION: MELVILLE, NY

DRILLER: S. Ramsdell

INSPECTOR: J. Pearl

DATE START: 7-26-96

DATE FINISH: 7-26-96

#### NEW ENGLAND BORING CONTRACTORS OF CT., INC.



HAMMER WT.

HAMMER FALL

128 KRIEGER LANE GLASTONBURY, CT 06033 (203) 633-4649 -- (413) 733-1232 FAX (203) 657-8046

Casing TYPE HSA SIZE I.D. 4-1/4" Sampler

Core Barrel

BORING No. P-2

SHEET 1 OF 1

ARCHITECT/ ENGINEER

FILE NO. ERIMELVI

SURFACE ELEV.

LINE & STATION

DATE	FINISH: 7-2							OFFSE	ET	
	SAMPLE  OEPTH BLOWS PER 6 ON SAMPLES					CASING BLOWS/			l	
No.	OEPTH RANGE IN FEET		ON S	AMPLER	REC.	CASING BLOWS/ CORING TIMES	FIELD CLASSIFICATION AND REMARKS		Wall Cons.	Installation Details
	IN FEET	0.6	-	12-18 18-2		PER FT.	Blacktop  Concrete  Light Brown Fine - Crs. Sand and Fine - Med Gravel	,1 .g.		Roadway Box 30' of 2" PVC Riser  7" Bentanite Chip Scal  10" of .010 Slot 2" PVC Screen  NJ #2 Sand
							End of Boring @ 40' No Water	40		Bottom of We
NOTES:	1) The stratifical approximate types Transi	HOW THE WOOD	tween sai	2) Water level a in the driet he conditions of Sucteations writer may or then these a unerrants was	dee at sample and on the base of the layer our due to the layer our due to the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of the layer out of	and under anné lago el grouns- clors ethar	REMARKS: Vaper Well			

CLIENT ERI

PROJECT NAME: 25 MELVILLE PARK

LOCATION: MELVILLE, NY

DRILLER: S. Ramsdell

INSPECTOR: J. Pearl

DATE START: 7-24-96

NEW ENGLAND BORING CONTRACTORS OF CT., INC.



TYPE

SIZE I.D.

129 KRIEGER LANE GLASTONBURY, CT 06033 (203) 633-4649 - (413) 733-1232 FAX (203) 657-8046

Casing

Samptor

Care Barrel

HSA 4-1/4

HAMMER WT. HAMMER FALL **BORING No. HP-6** 

SHEET 1 OF 1

ARCHITECT/ ENGINEER

FILE NO. ERIMELVI

SURFACE ELEV.

DATE	FINISH: 7-2	4-96			HAN	MMER FALL		OFFSE	T .	
	SAMPLE  DEPTH BLOWS PER 6* RANGE ON SAMPLER				,	CASING				
No.	DEPTH RANGE IN FEET	0-6	BLOWS PE ON SAMP	R 6" LER 2-18 18-24	REC.	CASING BLOWS/ CORING TIMES PER FT.	FIELD CLASSIFICATION AND REMARKS		Weil Cons.	Inetallation Octails
							Blacktop		<u> </u>	·
							Light Brown Med Crs. Sand and Fine - Med Gravel	.1 I.		
		-								
ı										
							End of Boring @ 58', Water @ 50'	58		
ITE3:	<ol> <li>The stratifical approximates types. Trans</li> </ol>	-	Rween sail	Warer level rea- in the drift holes or mertions state Mucrostons in water may expen-	d on the bo the level	oring logs. of graund	REMARKS: Hydro-punch @ 58'			

CLIENT: ERI

PROJECT NAME: 25 MELVILLE PARK

LOCATION: MELVILLE, NY

DRILLER: S. Ramadell

INSPECTOR J. Pearl

DATE START: 7-25-96

NEW ENGLAND BORING CONTRACTORS OF CT., INC.



129 KRIEGER LANE GLASTONBURY, CT 06033 (203) 633-4649 .. (413) 733-1232 FAX (203) 657-8046

Casing Sampter . Core Barrel TYPE HSA SS SIZE I.D. 4-1/4" 1-3/8" 140 HAMMER WT. HAMMER FALL

BORING No. HP-7

SHEET 1 OF 1

ARCHITECT/ ENGINEER

FILE NO ERIMELVI

SURFACE ELEV.

DATE FINISH: 7 - 25 - 96					HAN	AMER FALL	. 30"		OFFSET		
	SAMPLE				CASING						
No.	DEPTH RANGE IN FEET	0-8	BLOWS ON SA	PER 6 MPLER 12-18	18-24	REC.	CASING BLOWS/ CORING TIMES PER FT	FIELD CLASSIFICATION AND REMARKS		Wall Cons.	Installation Details
	IN PEET	0.8	6-12	]12-18	18-24		PER FT	Blacktop  Processed Gravel  Light Brown Fine - Crs. Sand and Fine - Med. Gravel	2		Roadway Box 30' of 2" PVC Riser
										Amanamada: - Injulitatintintintintintintintintintintintintint	Chip Seal  10' of .010 Slot 2" PVC Screen  NJ #2 Sand  Bottom of Well @ 40'
SI	45'.47'	18	20	29	29	12"		Light Brown Fine - Crs. Sand and Fine - Crs. Gravel, Few Cobbles	45 58		
NOTES: 1) The shietification from represent the soprational between the soprational between the services that typins. Transitionis may be primited typins. Transitionis may be primited to the service to the bennet of ground-water may occur durin to factors street on the service of the think made may occur durin to factors other than those greener, at the time mass-unember may over during the services.						s on times as s on the be the level of aum to fac-	nd under sting logs of ground- tors ather	End of Boring @ 58', Water @ 50' +/- REMARKS: Hydro-punch @ 58'			

CLIENT ERI

PROJECT NAME- 25 MELVILLE PARK

LOCATION: MELVILLE, NY

DRILLER S. Ramsdell

INSPECTOR: J. Pearl

DATE START: 7-25-96

#### NEW ENGLAND BORING CONTRACTORS OF CT., INC.



TYPE

SIZE t.D.

HAMMER WT.

HAMMER FALL

129 KRIEGER LANE GLASTONBURY, CT 06033 (203) 633-4649 -- (413) 733-1232 FAX (203) 657-8046

Casing HSA 4-1/4" Sampler

Core Barrel

BORING No. HP-8

SHEET 1 OF 1

ARCHITECT/ ENGINEER

FILE NO. ERIMELVI

SURFACE ELEV.

DATE FINISH: 7-26-96	HAMINER FAL		OFFSET		
No.   DEPTH   BLOWS PER 6   ON SAMPLER   ON SAMPLER   IN FEET   O-6   6-12   12-18   18-24	REC. CASING BLOWS/ CORING TIMES PER FT.	FIELD CLASSIFICATION AND REMARKS	Woll Cons.	Installation Dotails	
NOTES: 1) The prestriction lines represent the 2) Water lives to separate behavior between seri	Bedways have been trade	End of Boring @ 58', Water @ 50'  REMARKS: Hydro-punch @ 58'		Roadway Box 30° of 3" PVC Riser 13' Bentonite Chip Seal  10' of .020 Slot 3" PVC Screen NJ #2 Sand  Bottom of Well @ 40°	
Fluctuations I water may ac	ted on the bring ings in the level of ground- out due to factors other event at the time meas a made				