ENVIRONMENTAL ASSESSMENTS, INC.
POST OFFICE BOX 1631
36 NUGENT STREET, SOUTHAMPTON, NEW YORK 11968
516-283-5832

TELECOPIER COVER LETTER

To: Karen J. Gomez, Environmental Engineer 2/NYSDEC

From: Melissa A. Dedovich, Planner

Project: East Hampton Housing Authority

Total number of pages including cover: twenty (20)

If you do not receive all the pages, please call 516-283-5832.
Our facsimile number is 516-283-5974.

Remarks/Description:

For your review and comment.

30 #3 excavated

Copy to:

ENVIRONMENTAL ASSESSMENTS, INC.

RICHARD ERIK WARREN
President

September 7, 1993

- VIA FACSIMILE/MAIL -

James C. Maloney, Associate Public Health Engineer
SCDHS/Office of Waste Water Management
Griffing County Center
Riverhead, New York 11901

Karen J. Gomez, Environmental Engineer 2
NYS Department of Environmental Conservation/
Division of Spill Prevention & Remediation
SUNY - Building 40
Stony Brook, New York 11790-2356

**Re: East Hampton Housing Authority - Accabonac Project,
Situate Accabonac Highway, Town of East Hampton
SCTM No.: 0300-149-02-56.1.**

Dear Mr. Maloney and Ms. Gomez:

The following is an update of the remediation project presently occurring at the East Hampton Housing Authority's 33.262 acre site located on Accabonac Highway, Town of East Hampton. As you may recall, a Phase I Environmental Audit had been prepared by this firm, Environmental Assessments, Inc., which revealed several limited areas of possible environmental concern including limited areas of surficial debris disposal. Accordingly, a limited scale remediation program to involve additional testing and a surficial clean up was drawn up and forwarded to both of your agencies on February 23, 1993, together with a copy of the original environmental investigation report, for each agency's review and approval.

Written acknowledgements were received by this office from both the Suffolk County Department of Health Services (SCDHS) and the New York State Department of Environmental Conservation (NYSDEC) on March 15, 1993 and April 14, 1993, respectively. Follow-up telephone conversations verified that this proposed remediation project met with both of your departments' approval.

As such, the work outlined in this remediation program has been undertaken on this site during the past few months. As of this date, all the surficial debris present on this parcel, including the abandoned vehicles which were present along the southern property line, have been removed from the site. A random

38 NUGENT STREET
POST OFFICE BOX 1631
SOUTHAMPTON, NEW YORK 11969
516-283-5832

electromagnetic scan of the property after the completion of this surficial clean up did not reveal the presence of any buried drums and/or tanks on the subject site. Additionally, test trenching of the berm area located along the southern section of the parcel revealed this berm to be only composed of stockpiled topsoils, with no evidence of the burial of any type of solid wastes present.

Upon the completion of the removal of all surficially disposed of items and materials, a follow-up photoionization detection analysis (PID) of the site was undertaken by Environmental Assessments, Inc. on August 9-10, 1993 in accordance with the remediation scoping outline. It was noted that no above-ambient soil gas readings were observed at any location in either the northern or central portions of this property.

Elevated PID readings were revealed at certain small and specific areas during the intensive photoionization detection (PID) sweep of the "cleaned" area of surficial disposal situated along the southern property line. These identified elevated readings were only observed at a few of the flagged locations where abandoned vehicles had previously been situated. Surficial soil samples were therefore collected at this time for further analysis to determine the actual surficial soil contaminant present in these limited "spots."

A total of nine (9) soil samples were collected at locations where sustained elevated PID readings were observed, at an approximate depth of between 6-12 inches. Six (6) of these samples were analyzed for Total Petroleum Hydrocarbons (TPH), as the previous presence of abandoned vehicles and drums indicated the possibility that petroleum spillage may be the cause of the above-normal soil gas readings. To ensure that no other contamination might exist, three (3) samples were collected to be analyzed for Volatile Organic Compounds (VOC's) and Xylenes. It should be noted that no surficial soil staining was noted during this PID sweep or soil sample collection. These samples were forwarded to H2M Laboratories, Inc. for analysis.

The results of this limited surficial soil sampling have recently been received by this office and have been attached for your reference. Based upon a review of these results, it appears that, although no petroleum hydrocarbon contamination was found to exist on this site, 1,1,1-trichloroethane was revealed to be present in all three (3) of the VOC samples. Two of these three samples contained concentrations of this constituent which exceeded NYSDEC soil guideline limits.

Of interest is the fact that two (2) groundwater monitoring wells were installed on August 11-13, 1993, in accordance with the request of Mr. Joseph H. Baier of the SCDHS, in the same

areas where elevated soil gas readings were obtained. This installation and associated soil/groundwater testing and analysis was supervised by Fanning, Phillips and Molnar Engineering firm, the consulting engineers for the Town of East Hampton. Split-spoon soil samples were collected for analysis at depths of between 2-4 feet during the installation of these wells. Both these samples and the water samples collected from these two (2) groundwater monitoring wells were all found to be clean of any type of contamination (see attached results). As such, it appears that the 1,1,1-trichlororethane contamination present is surficial in nature and has not vertically migrated.

It is therefore recommended that a proper removal of these affected soils off-site be conducted. Such a remediation will involve the identification of each affected area by use of a PID and the subsequent excavation of the contaminated soils from each of these specific locations. These soils would then be stockpiled together onto polysheeting, with one (1) composite soils sample collected for TCLP (Toxic Characteristic Leaching Procedure) analysis. This specific test will characterize these contaminated soils for proper disposal by determining whether this removed material is considered hazardous or non-hazardous.

Confirmatory (endpoint) samples will be collected from at least three (3) separate excavation areas to ensure that a complete remediation has been accomplished. Each of these created "holes" will be fenced-off until the receipt of these confirmatory sample analyses. If these results indicate a complete remediation, each of these holes will subsequently be backfilled with an equivalent amount of clean fill.

Similarly, once the TCLP results are received by this office, the excavated soils will be properly contained to be removed from the site in an appropriate manner. It is presently thought that, considering the amount of soil involved, this material will be able to be "barreled" for removal.

On behalf of East Hampton Housing Authority, I have contacted Mr. Michael Flynn of Advance Environmental Services, Inc. to complete this necessary soil remediation. Please be aware that Environmental Assessments, Inc. will be supervising this entire project, including the collection of all required soil samples to be forwarded for analysis.

Presently, this site remediation is scheduled for this Thursday, September 9, 1993 to begin at 8:00 am. Should you wish be present during this clean-up or to inspect the site at a later date, arrangements can be made directly through this office. I spoke directly with Mr. Alex Santino of the SCDHS this morning concerning this planned clean-up and have received a verbal approval from his department to commence this project.

It should be noted that copies of the endpoint (confirmatory) samples collected upon the completion of this remedial work will be provided to each of your individual agencies for your records. It is further requested that, upon your receipt of these analyses results, a letter be provided from each of your offices acknowledging that a satisfactory remediation of this site has been completed.

If you have any questions with regards to this letter or should you require additional information, please do not hesitate to contact this office.

Respectfully submitted,

Melissa A. Dedovich
Planner

MAD:mjb
enclosures
copy to: Tony Bullock, East Hampton Town Supervisor
Christopher D. Kelley, Esq.
Alex Santino, Hazardous Waste Senior Engineer

HZM LABS, INC.
575 Broad Hollow Road, Melville, N.Y. 11747
(516)694-3040 FAX:(516)694-4122

LAB NO: 9325699

ENVIRONMENTAL ASSESSMENTS, INC
MELISSA DEDOVICH
P.O. BOX #1631
SOUTHAMPTON, NY 11968

TYPE..... SOIL
SPECIAL
METHOD.... GRAB

DATE COLLECTED. 08/10/93
DATE RECEIVED.. 08/12/93
COLLECTED BY... CL99

POINT NO:
LOCATION: EHHA #5

REMARKS: EAST HAMPTON HOUSING AUTHORITY
(SCTM #0904-015-01028)

PARAMETER (S)	RESULTS	UNITS
PETROLEUM HYDROCARBON(IR)	<33.4	mg/kg
TOTAL SOLIDS	93.6	%

COPIES TO:

DATE ISSUED 08/27/93

ORIGINAL

LABORATORY DIRECTOR

H2M LABS, INC.
575 Broad Hollow Road, Melville, N.Y. 11747
(516)694-3040 FAX:(516)694-4122

LAB NO: 9325700

ENVIRONMENTAL ASSESSMENTS, INC
MELISSA DEDOVICH
P.O. BOX #1631
SOUTHAMPTON, NY 11968

TYPE..... SOIL
SPECIAL
METHOD.... GRAB

DATE COLLECTED. 08/10/93
DATE RECEIVED.. 08/12/93
COLLECTED BY... CL99

POINT NO:
LOCATION: EHHA #9

REMARKS: EAST HAMPTON HOUSING AUTHORITY
(SCTM #0904-015-01028)

PARAMETER (S)	RESULTS	UNITS
PETROLEUM HYDROCARBON(IR)	<33.5	mg/kg
TOTAL SOLIDS	93.4	%

COPIES TO:

DATE ISSUED 08/27/93

J M Glavin
LABORATORY DIRECTOR

ORIGINAL

H2M LABS, INC.
575 Broad Hollow Road, Melville, N.Y. 11747
(516)694-3040 FAX:(516)694-4122

LAB NO: 9325700

ENVIRONMENTAL ASSESSMENTS, INC
MELISSA DEDOVICH
P.O. BOX #1631
SOUTHAMPTON, NY 11968

TYPE..... SOIL
SPECIAL
METHOD.... GRAB

DATE COLLECTED. 08/10/93
DATE RECEIVED.. 08/12/93
COLLECTED BY... CL99

POINT NO:
LOCATION: EHHA #9

REMARKS: EAST HAMPTON HOUSING AUTHORITY
(SCTM #0904-015-01028)

VOLATILE ORGANIC COMPOUNDS - (ug/kg)

PARAMETER (S)	RESULT	TAGM 4046 Guideline	PARAMETER (S)	RESULT
DICHLORODIFLUOROMETHANE	<50		1,4-XYLENE	<50
CHLOROMETHANE	<50		1,2-XYLENE	<50
VINYL CHLORIDE	<50			
BROMOMETHANE	<50			
CHLOROETHANE	<50			
FLUOROTRICHLOROMETHANE	<50			
1,1-DICHLOROETHENE	<50			
METHYLENE CHLORIDE	<50			
TRANS-1,2-DICHLOROETHENE	<50			
1,1-DICHLOROETHANE	<50			
CIS-1,2-DICHLOROETHENE	<50			
CHLOROFORM	<50			
1,1,1-TRICHLOROETHANE	8000	800		
CARBON TETRACHLORIDE	<50			
1,2-DICHLOROETHANE	<50			
TRICHLOROETHENE	<50			
1,2-DICHLOROPROPANE	<50			
BROMODICHLOROMETHANE	<50			
TRANS-1,3-DICHLOROPROPENE	<50			
CIS-1,3-DICHLOROPROPENE	<50			
1,1,2-TRICHLOROETHANE	<50			
TETRACHLOROETHENE	<50			
CHLORODIBROMOMETHANE	<50			
CHLOROBENZENE	<50			
BROMOFORM	<50			
1,1,2,2-TETRACHLOROETHANE	<50			
M-DICHLOROBENZENE	<50			
P-DICHLOROBENZENE	<50			
O-DICHLOROBENZENE	<50			
BENZENE	<50			
TOLUENE	<50			
ETHYLBENZENE	<50			
1,3-XYLENE	<50			

COPIES TO:

DATE ISSUED 08/27/93

DATE RUN..... 08/26/93
DATE REPORTED.. 08/27/93

ORIGINAL

LABORATORY DIRECTOR

HZM LABS, INC.
575 Broad Hollow Road, Melville, N.Y. 11747
(516)694-3040 FAX:(516)694-4122

LAB NO: 9325701

ENVIRONMENTAL ASSESSMENTS, INC
MELISSA DEDOVICH
P.O. BOX #1631
SOUTHAMPTON, NY 11968

TYPE..... SOIL
SPECIAL
METHOD.... GRAB

DATE COLLECTED. 08/10/93
DATE RECEIVED.. 08/12/93
COLLECTED BY... CL99

POINT NO:
LOCATION: EHHA #10-A

REMARKS: EAST HAMPTON HOUSING AUTHORITY
(SCTM #0904-015-01028)

PARAMETER (S)	RESULTS	UNITS
PETROLEUM HYDROCARBON(IR)	<33.9	mg/kg
TOTAL SOLIDS	92.2	%

COPIES TO:

DATE ISSUED 08/27/93

ORIGINAL

J M Slavin
LABORATORY DIRECTOR

HZM LABS, INC.
575 Broad Hollow Road, Melville, N.Y. 11747
(516)694-3040 FAX:(516)694-4122

LAB NO: 9325701

ENVIRONMENTAL ASSESSMENTS, INC
MELISSA DEDOVICH
P.O. BOX #1631
SOUTHAMPTON, NY 11968

TYPE..... SOIL
SPECIAL
METHOD.... GRAB

DATE COLLECTED. 08/10/93
DATE RECEIVED.. 08/12/93
COLLECTED BY... CL99

POINT NO:
LOCATION: EHHA #10-A

REMARKS: EAST HAMPTON HOUSING AUTHORITY
(SCTM #0904-015-01028)

VOLATILE ORGANIC COMPOUNDS - (ug/kg)

PARAMETER (S)	RESULT	PARAMETER (S)	RESULT
DICHLORODIFLUOROMETHANE	<50	1,4-XYLENE	<50
CHLOROMETHANE	<50	1,2-XYLENE	<50
VINYL CHLORIDE	<50		
BROMOMETHANE	<50		
CHLOROETHANE	<50		
FLUOROTRICHLOROMETHANE	<50		
1,1-DICHLOROETHENE	<50		
METHYLENE CHLORIDE	<50		
TRANS-1,2-DICHLOROETHENE	<50		
1,1-DICHLOROETHANE	<50		
CIS-1,2-DICHLOROETHENE	<50		
CHLOROFORM	<50		
1,1,1-TRICHLOROETHANE	800		
CARBON TETRACHLORIDE	<50		
1,2-DICHLOROETHANE	<50		
TRICHLOROETHENE	<50		
1,2-DICHLOROPROPANE	<50		
BROMODICHLOROMETHANE	<50		
TRANS-1,3-DICHLOROPROPENE	<50		
CIS-1,3-DICHLOROPROPENE	<50		
1,1,2-TRICHLOROETHANE	<50		
TETRACHLOROETHENE	<50		
CHLORODIBROMOMETHANE	<50		
CHLOROBENZENE	<50		
BROMOFORM	<50		
1,1,2,2-TETRACHLOROETHANE	<50		
M-DICHLOROBENZENE	<50		
P-DICHLOROBENZENE	<50		
O-DICHLOROBENZENE	<50		
BENZENE	<50		
TOLUENE	<50		
ETHYLBENZENE	<50		
1,3-XYLENE	<50		

TAGM 4046 guideline 800 ppb

COPIES TO:

DATE ISSUED 08/27/93

DATE RUN..... 08/26/93
DATE REPORTED.. 08/27/93

ORIGINAL

J. M. Slavin
LABORATORY DIRECTOR

HZM LABS, INC.
575 Broad Hollow Road, Melville, N.Y. 11747
(516)694-3040 FAX:(516)694-4122

LAB NO: 9325702

ENVIRONMENTAL ASSESSMENTS, INC
MELISSA DEDOVICH
P.O. BOX #1631
SOUTHAMPTON, NY 11968

TYPE..... SOIL
SPECIAL
METHOD.... GRAB

DATE COLLECTED. 08/10/93
DATE RECEIVED.. 08/12/93
COLLECTED BY... CL99

POINT NO:
LOCATION: EHHA #14

REMARKS: EAST HAMPTON HOUSING AUTHORITY
(SCTM #0904-015-01028)

PARAMETER (S)	RESULTS	UNITS
PETROLEUM HYDROCARBON(IR)	<32.4	mg/kg
TOTAL SOLIDS	96.6	%

COPIES TO:

DATE ISSUED 08/27/93

J M Marino
LABORATORY DIRECTOR

ORIGINAL

HZM LABS, INC.
575 Broad Hollow Road, Melville, N.Y. 11747
(516)694-3040 FAX:(516)694-4122

LAB NO: 9325703

ENVIRONMENTAL ASSESSMENTS, INC
MELISSA DEDOVICH
P.O. BOX #1631
SOUTHAMPTON, NY 11968

TYPE..... SOIL
SPECIAL
METHOD.... GRAB

DATE COLLECTED. 08/10/93
DATE RECEIVED.. 08/12/93
COLLECTED BY... CL99

POINT NO:
LOCATION: EHHA #16

REMARKS: EAST HAMPTON HOUSING AUTHORITY
(SCTM #0904-015-01028)

PARAMETER (S)	RESULTS	UNITS
PETROLEUM HYDROCARBON(IR)	<35.1	mg/kg
TOTAL SOLIDS	89.2	%

COPIES TO:

DATE ISSUED 08/27/93

J M Slavin
LABORATORY DIRECTOR

ORIGINAL

HZM LABS, INC.
575 Broad Hollow Road, Melville, N.Y. 11747
(516)694-3040 FAX:(516)694-4122

LAB NO: 9325703

ENVIRONMENTAL ASSESSMENTS, INC
MELISSA DEDOVICH
P.O. BOX #1631
SOUTHAMPTON, NY 11968

TYPE..... SOIL
SPECIAL
METHOD.... GRAB

DATE COLLECTED. 08/10/93
DATE RECEIVED.. 08/12/93
COLLECTED BY... CL99

POINT NO:
LOCATION: EHHA #16

REMARKS: EAST HAMPTON HOUSING AUTHORITY
(SCTM #0904-015-01028)

VOLATILE ORGANIC COMPOUNDS - (ug/kg)

PARAMETER (S)	RESULT	PARAMETER (S)	RESULT
DICHLORODIFLUOROMETHANE	<50	1,4-XYLENE	<50
CHLOROMETHANE	<50	1,2-XYLENE	<50
VINYL CHLORIDE	<50		
BROMOMETHANE	<50		
CHLOROETHANE	<50		
FLUOROTRICHLOROMETHANE	<50		
1,1-DICHLOROETHENE	<50		
METHYLENE CHLORIDE	<50		
TRANS-1,2-DICHLOROETHENE	<50		
1,1-DICHLOROETHANE	<50		
CIS-1,2-DICHLOROETHENE	<50		
CHLOROFORM	<50		
[redacted]	<10		
CARBON TETRACHLORIDE	<50		
1,2-DICHLOROETHANE	<50		
TRICHLOROETHENE	<50		
1,2-DICHLOROPROPANE	<50		
BROMODICHLOROMETHANE	<50		
TRANS-1,3-DICHLOROPROPENE	<50		
CIS-1,3-DICHLOROPROPENE	<50		
1,1,2-TRICHLOROETHANE	<50		
TETRACHLOROETHENE	<50		
CHLORODIBROMOMETHANE	<50		
CHLOROBENZENE	<50		
BROMOFORM	<50		
1,1,2,2-TETRACHLOROETHANE	<50		
M-DICHLOROBENZENE	<50		
P-DICHLOROBENZENE	<50		
O-DICHLOROBENZENE	<50		
BENZENE	<50		
TOLUENE	<50		
ETHYLBENZENE	<50		
1,3-XYLENE	<50		

COPIES TO:

DATE ISSUED 08/27/93

DATE RUN..... 08/26/93
DATE REPORTED.. 08/27/93

ORIGINAL

LABORATORY DIRECTOR

FZM LABS, INC.
INTERSCIENCE
575 Broad Hollow Road, Melville, N.Y. 11747
(516)694-3040 FAX:(516)694-4122

LAB NO: 9325704

ENVIRONMENTAL ASSESSMENTS, INC
MELISSA DEDOVICH
P.O. BOX #1631
SOUTHAMPTON, NY 11968

TYPE..... SOIL
SPECIAL
METHOD.... GRAB

DATE COLLECTED. 08/10/93
DATE RECEIVED.. 08/12/93
COLLECTED BY... CL99

POINT NO:
LOCATION: EHHA #17

REMARKS: EAST HAMPTON HOUSING AUTHORITY
(SCTM #0904-015-01028)

PARAMETER (S)	RESULTS	UNITS
PETROLEUM HYDROCARBON(IR)	<37.6	mg/kg
TOTAL SOLIDS	83.2	%

COPIES TO:

DATE ISSUED 08/27/93

J.M. Glavin
LABORATORY DIRECTOR

ORIGINAL

YAL
York Analytical Laboratories, Inc.

One Research Drive
Stamford, CT 06906
(203) 325-1371
Fax (203) 357-0166

Technical Report

prepared for

Fanning, Phillips & Molnar
909 Marconi Avenue
Rokonkoma, NY 11779
Attention: Ms. Monica Tsang

Project No. 93576
August 20, 1993

Project No 93600
August 27, 1993
Fanning, Phillips & Molnar
909 Marconi Avenue
Ronkonkoma, NY 11779
Attention: Ms. Monica Tsang

Purpose and Results

Two water samples identified as "GW-1 and GW-2 - East Hampton Housing" and one field blank were sampled by Fanning, Phillips & Molnar and submitted to York Analytical Laboratories, Inc. On August 20, 1993 for the determination of Volatiles (601/602 list). A copy of the chain-of-custody is attached.

The samples were analyzed according to EPA 600 Series Methods.

The results of the analysis are shown in Table 1.0.

Table 1.0 - Volatiles (601/602 lists) Data-ppb (ug/L)-Waters

	Sample Identification			
Dilution Factor	1	1	1	1
Parameter	MDL[1]	GW-1	GW-2	Field Blank
Chloromethane	10	ND[3]	ND	ND
Bromoethane	10	ND	ND	ND
Vinyl Chloride	10	ND	ND	ND
Chloroethane	10	ND	ND	ND
Methylene Chloride	1	ND	ND	ND
Dichlorodifluoromethane	1	ND	ND	ND
Trichlorofluoromethane	1	ND	ND	ND
1,1-Dichloroethylene	1	ND	ND	ND
1,1-Dichloroethane	1	ND	ND	ND
1,2-Dichloroethylene	1	ND	ND	ND
Chloroform	1	ND	ND	ND
1,2-Dichloroethane	1	ND	ND	ND
1,1,1-Trichloroethane	1	ND	ND	ND
Carbon Tetrachloride	1	ND	ND	ND
Bromodichloromethane	1	ND	ND	ND
1,2-Dichloropropane	1	ND	ND	ND
t-1,3-dichloropropylene	1	ND	ND	ND
Trichloroethylene	1	ND	ND	ND
Dibromochloromethane	1	ND	ND	ND
1,1,2-Trichloroethane	1	ND	ND	ND
c-1,3-dichloropropylene	1	ND	ND	ND
2-chloroethylvinylether	1	ND	ND	ND
Bromoform	1	ND	ND	ND
1,1,2,2-Tetrachloroethene	1	ND	ND	ND
Tetrachloroethylene	1	ND	ND	ND
1,2-Dichlorobenzene	1	ND	ND	ND
1,4-Dichlorobenzene	1	ND	ND	ND
1,3-Dichlorobenzene	1	ND	ND	ND
Chlorobenzene	1	ND	ND	ND
Benzene	1	ND	ND	ND
Toluene	1	ND	ND	ND
Ethyl Benzene	1	ND	ND	ND
MTBE	1	ND	ND	ND

1 Minimum Data Quantitation Limit (Practical Quantitation Limit) for dilution factor = 1; MDL's for other dilution factors are determined by multiplying MDL by dilution factor.

2 Sample requiring a dilution is prepared such that the target compounds in the highest calibration standard is within the linear range of the analytical system for the target compounds. (Five when necessary per the EPA Protocols.)

3 Not Detectable

YAL
York Analytical Laboratories, Inc.

One Research Drive
Stamford, CT 06906
(203) 325-1371
Fax (203) 357-0166

Technical Report

prepared for

Fanning, Phillips & Molnar
909 Marconi Avenue
Ronkonkoma, NY 11779
Attention: Ms. Monica Tsang

Project No. 93600
August 27, 1993

Project No. 93576
August 20, 1993
Fanning, Phillips & Molnar
909 Marconi Avenue
Rokonkoma, NY 11779
Attention: Ms. Monica Tsang

Purpose and Results

Two soil samples identified as "GW-2 (2'-4') and GW-1 (2'-4') - East Hampton Housing" were sampled by Fanning, Phillips & Molnar and submitted to York Analytical Laboratories, Inc. On August 17, 1993 for the determination of Volatiles (601/602+MTBE list). A copy of the chain-of-custody is attached.


The samples were analyzed according to EPA 600 Series Methods.

The results of the analysis are shown in Table 1.0.

Table 1.0 - Volatiles (601/602 lists) Data-ppb (ug/Kg)-Soils

	Sample Identification		
Dilution Factor	1	1	1
Parameter	MDL[1]	GW-2 (2-4')	GW-1 (2-4')
Chloromethane	10	ND[3]	ND
Bromoethane	10	ND	ND
Vinyl Chloride	10	ND	ND
Chloroethane	10	ND	ND
Methylene Chloride	1	ND	ND
Dichlorodifluoromethane	1	ND	ND
Trichlorofluoromethane	1	ND	ND
1,1-Dichloroethylene	1	ND	ND
1,1-Dichloroethane	1	ND	ND
1,2-Dichloroethylene	1	ND	ND
Chloroform	1	ND	ND
1,2-Dichlorethane	1	ND	ND
1,1,1-Trichloroethane	1	ND	ND
Carbon Tetrachloride	1	ND	ND
Bromodichloromethane	1	ND	ND
1,2-Dichloropropane	1	ND	ND
t-1,3-dichloropropylene	1	ND	ND
Trichloroethylene	1	ND	ND
Dibromochloromethane	1	ND	ND
1,1,2-Trichloroethane	1	ND	ND
c-1,3-dichloropropylene	1	ND	ND
2-chloroethylvinylether	1	ND	ND
Bromoform	1	ND	ND
1,1,2,2-Tetrachloroethene	1	ND	ND
Tetrachloroethylene	1	ND	ND
1,2-Dichlorobenzene	1	ND	ND
1,4-Dichlorobenzene	1	ND	ND
1,3-Dichlorobenzene	1	ND	ND
Chlorobenzene	1	ND	ND
Benzene	1	ND	ND
Toluene	1	ND	ND
Ethyl Benzene	1	ND	ND
MTBE	1	ND	ND

1. Minimum Detectable Limit (Practical Quantitation Limit) for dilution factor = 1, MDL's for other dilution factors are determined by multiplying MDL by dilution factor.
2. Sample required a dilution to properly analyze (to get the target compounds in the working range of the analytical system for the target compounds. (This was necessary per the EPA Protocols to properly quantitate the sample.
3. Not Detectable

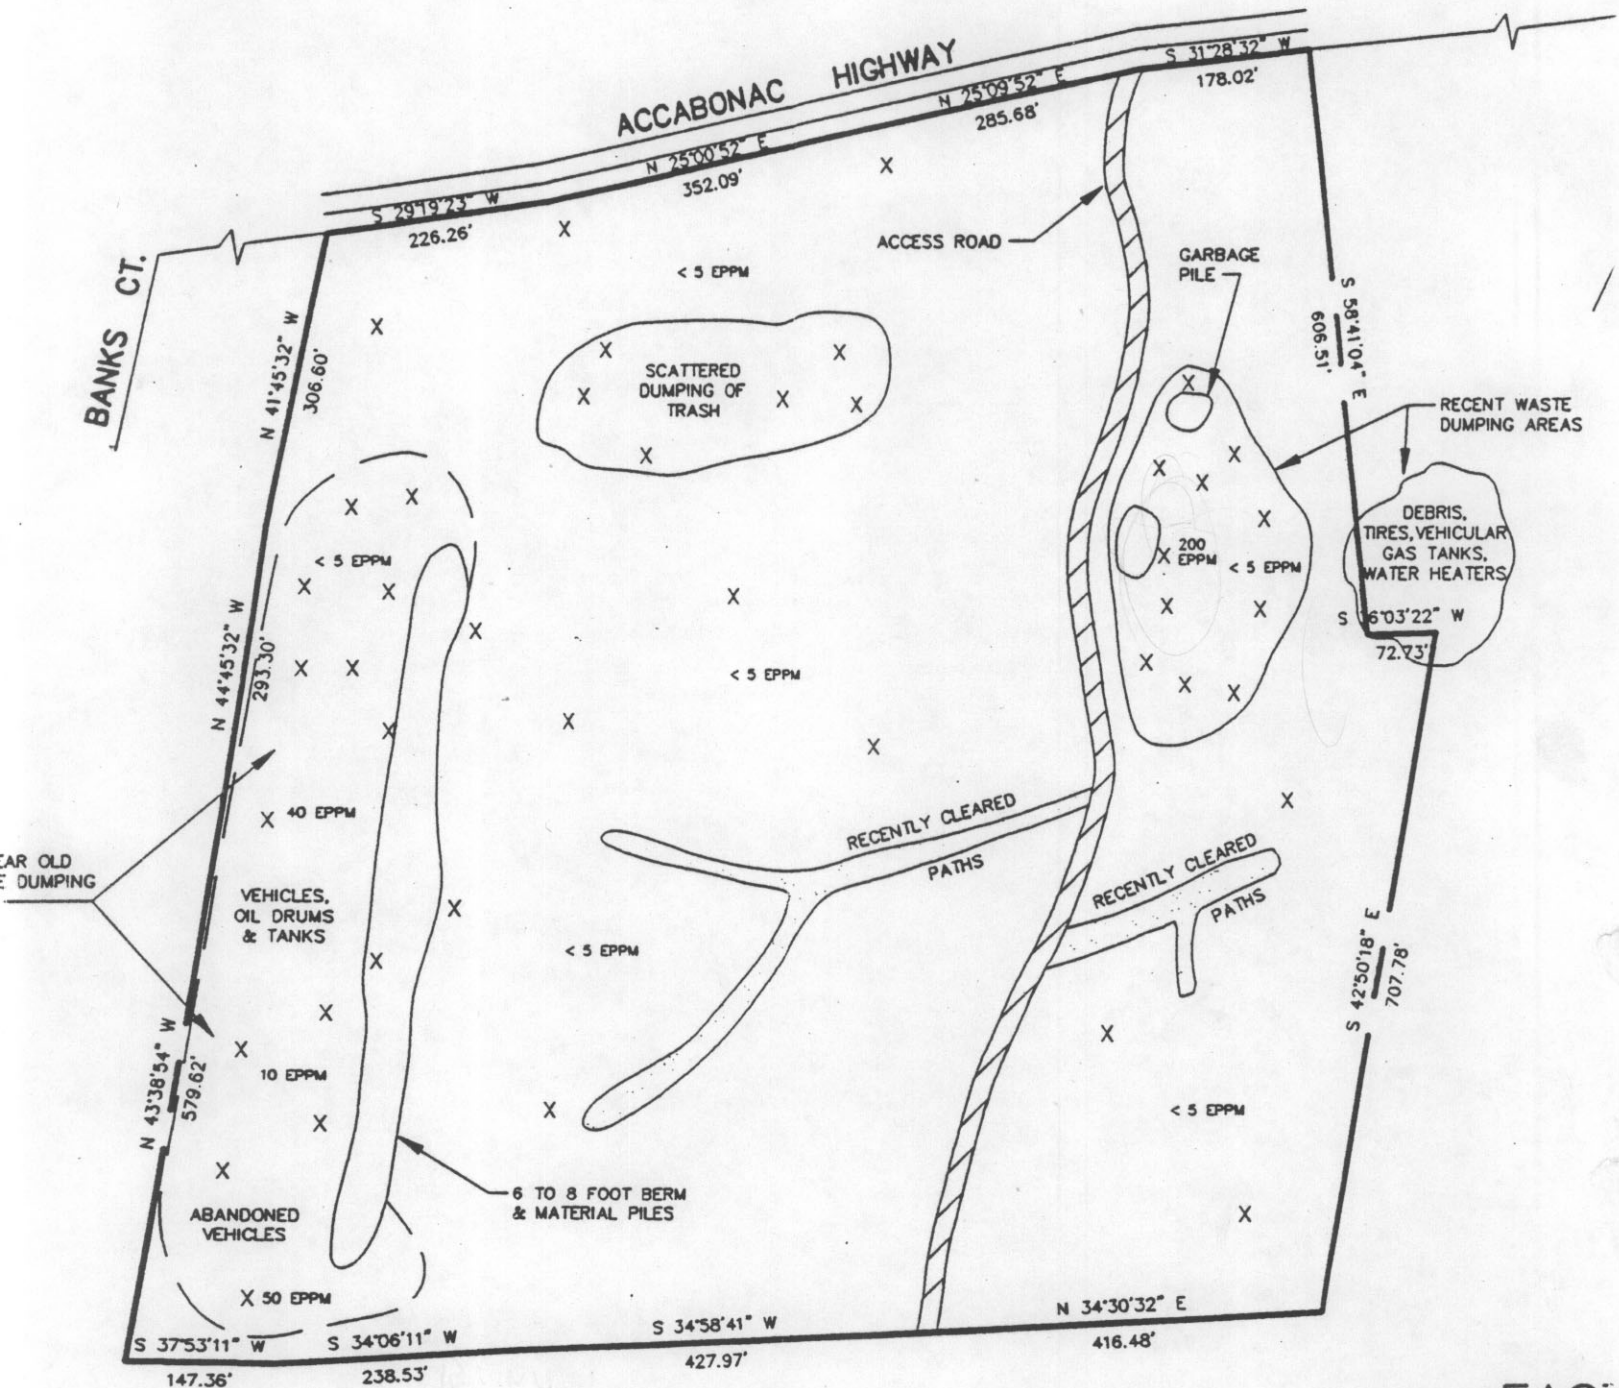

SITE PLAN

SCALE: 1" = 200'

SITE AREA = 33.3 ACRES

EAS
AU
EAS

PREPARED 10-2

H2MGROUP ENGINEERS · ARC
MELVILLE, N.Y.