Crompco LLC
1815 Gallagher Rd
Plymouth Meeting, PA 19462

7-Eleven Stores, Inc
Location #45098

504 West Main Street
Palmyra, NY 14522
+1 315-597-3830

Emergency Stop

Equipment #	Location	Result
1	Entrance to Store	Pass
2	Behind Counter	

Leak Detector

Equipment #	Grade	Pump Type	Result
017A	Premium	Electronic (ELLD)	Pass
017B	Regular	Electronic (ELLD)	Pass

Precision Line Tightness Test

Equipment #	Grade	Result
017A	Premium	Pass
017B	Regular	Pass

Shear Valve

Form Name	Result
Shear Valve	Pass

UST / AST Monitor

Form Name	Result
UST / AST Monitor	Pass

Veeder Root TLS-450 PLUS Software Upgrade

Form Name	Result
Veeder Root TLS-450 PLUS Software Upgrade	Completed

Brian Burch

Christopher Coles

EMERGENCY STOP SWITCH OPERATION INSPECTION

Facility Name: Speedway 45098		Owner: 7-Eleven Stores, Inc	
Address: 504 West Main Street		Address:	
City, State, Zip Code: Palmyra NY 14522		City, State, Zip Code:	
Facility I.D. #: 8-417572		Phone #: 3155973830	
Testing Company: Owl Services USA		Phone #: 610-278-7203	Date: 5/14/2026

This procedure is to verify the operation of all emergency stop switches/buttons (E-stops). Each E-stop must disconnect power to dispensers, submersible turbine pumps (STPs) and all non-intrinsically safe electrical equipment in classified areas. Test each E-stop separately. See PEI/RP1200 Section 11 for the inspection procedure.

E-stop Number or ID	1	2				
Location	Entrance to Store	Behind Counter				
1. E-stops labeled and located where easily accessible?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
2. System fully powered and in normal operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
3. After activating E-stop, power disconnected from:						
3a. All dispensing devices on all islands?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
3b. All STPs for all fuel grades?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
3c. All power, control and signal circuits associated with the dispensing devices and the STPs?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
3d. All other non-intrinsically safe electrical equipment in classified areas surrounding fuel dispensing devices?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
4. All intrinsically safe electrical equipment remains energized after E-stop activation?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
5. After testing, E-stop has been reset and power reestablished to normal operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
A "No" to lines 3a-3d indicates a test failure.						
Test Results	✓ Pass Fail	✓ Pass Fail	Pass Fail	Pass Fail	Pass Fail	Pass Fail

Comments:

Testing was conducted in accordance with PEI/RP1200

Tester's Name (print) Christopher Coles Tester's Signature 

1 Entrance to Store

2 Behind Counter

MECHANICAL AND ELECTRONIC LINE LEAK DETECTORS
PERFORMANCE TESTS

Facility Name: Speedway			Owner: 7-Eleven Stores, Inc			
Address: 504 West Main Street			Address:			
City, State, Zip Code: Palmyra NY 14522			City, State, Zip Code:			
Facility I.D. #: 8-417572			Phone #: 3155973830			
Testing Company: Owl Services USA			Phone #: 800-646-3161		Date: 5/14/2026	

This data sheet can be used to test mechanical line leak detectors (MLLD) and electronic line leak detectors (ELLD) with submersible turbine pump (STP) systems. See PEI/RP1200 Sections 9.1 and 9.2 for test procedures.

Line Number	017A	017B				
Product Stored	Premium	Regular				
Leak Detector Manufacturer	Veeder	Veeder				
Leak Detector Model	PLLD	PLLD				
Type of Leak Detector	☐ MLLD ☑ ELLD	☐ MLLD ☑ ELLD	☐ MLLD ☐ ELLD	☐ MLLD ☐ ELLD	☐ MLLD ☐ ELLD	☐ MLLD ☐ ELLD
MLLD (ALL PRESSURE MEASUREMENTS ARE MADE IN PSIG)						
STP Full Operating Pressure						
Check Valve Holding Pressure						
Line Resiliency (ml) (line bleed back volume as measured from check valve holding pressure to 0 psig)						
Step Through Time in Seconds (time the MLLD hesitates at metering pressure before going to full operating pressure as measured from 0 psig with no leak induced on the line)						
Metering Pressure (STP pressure when simulated leak rate 3 gph at 10 psig)						
Opening Time in Seconds (the time the MLLD opens to allow full pressure after simulated leak is stopped)						
Does the STP pressure remain at or below the metering pressure for at least 60 seconds when the simulated leak is induced?	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Does the leak detector reset (trip) when the line pressure is bled off to zero psig?	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Does the STP properly cycle on/off under normal fuel system operation conditions?	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
A "No" answer to either of the above questions indicates the MLLD fails the test.						
ELLD (ALL PRESSURE MEASUREMENTS ARE MADE IN PSIG)						
STP Full Operating Pressure	30	30				
How many test cycles are observed before alarm/shutdown occurs?	2	2				
Does the simulated leak cause an alarm?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
A "No" answer to the above question indicates the ELLD fails the test.						
Does the simulated leak cause an STP shutdown?	☑ Yes ☐ No ☐ NA	☑ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA
Test Results	☒ Pass ☐ Fail	☒ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail

Comments: Testing was conducted in accordance with PEI/RP1200

Tester Signature: Chris Coles

Tester Name: Christopher Coles

Speedway
504 West Main Street
Palmyra
NY 14522

Purpora Engineering
Petro-Tite Line Tightness Test Form

Work Visit # 182202
UST Registration #
8-417572

IDENTIFY EACH LINE AS TESTED	TIME (MILITARY)	LOG OF TEST PROCEDURES, AMBIENT TEMPERATURE, WEATHER, ETC.	PRESSURE PSI BEFORE	PRESSURE PSI AFTER	VOLUME READING BEFORE	VOLUME READING AFTER	VOLUME NET CHANGE	REMARKS SIZE, LENGTH & TYPE OF LINE, #FLEX CONNECTORS, CONCLUSIONS
017A	02:10	Connected line tester to: Shear						
Premium	02:20	Started line test		60		.001		
	02:30	Line Test Continued	60	60	.001	.001	0	
	02:40	Line Test Continued	60	60	.001	.001	0	
	02:50	Line Test Continued	60	60	.001	.001	0	
	03:00	Bleed Back	60	0	.001	.152	0.151	

Material Enviroflex (blue)

Wall Type Single

Line Length (feet) 100

Diameter (inches) 1.5

Pressure/Suction Pressure

Allowable Bleedback

(PL x Ba) + (FC x Bb(.006)) + B(.05) = N

(100 * 0.002)
+ (0 * 0.006) + 0.05 = 0.25

Tests were made on the above line systems in accordance with test procedures prescribed for as detailed on attached test charts with the results as follows:

Line Identification	Meets Criteria (Yes/No)	Net Volume Change Per Hour	Date Tested
017A Premium	Yes	0	5/14/2026

CONTRACTOR CERTIFICATION

Technician:
Christopher Coles

0b7633ae
Certification # _____

Notes:

Speedway
504 West Main Street
Palmyra
NY 14522

Purpora Engineering
Petro-Tite Line Tightness Test Form

Work Visit # 182202
UST Registration #
8-417572

IDENTIFY EACH LINE AS TESTED	TIME (MILITARY)	LOG OF TEST PROCEDURES, AMBIENT TEMPERATURE, WEATHER, ETC.	PRESSURE PSI BEFORE	PRESSURE PSI AFTER	VOLUME READING BEFORE	VOLUME READING AFTER	VOLUME NET CHANGE	REMARKS SIZE, LENGTH & TYPE OF LINE, #FLEX CONNECTORS, CONCLUSIONS
017B	02:12	Connected line tester to: Shear						
Regular	02:22	Started line test		60		.001		
	02:32	Line Test Continued	60	60	.001	.001	0	
	02:42	Line Test Continued	60	60	.001	.001	0	
	02:52	Line Test Continued	60	60	.001	.001	0	
	03:02	Bleed Back	60	0	.001	.168	0.167	

Material Enviroflex (blue)

Wall Type Single

Line Length (feet) 100

Diameter (inches) 1.5

Pressure/Suction Pressure

Allowable Bleedback

(PL x Ba) + (FC x Bb(.006)) + B(.05) = N

(100 * 0.002)
+ (0 * 0.006) + 0.05 = 0.25

Tests were made on the above line systems in accordance with test procedures prescribed for as detailed on attached test charts with the results as follows:

Line Identification	Meets Criteria (Yes/No)	Net Volume Change Per Hour	Date Tested
017B Regular	Yes	0	5/14/2026

CONTRACTOR CERTIFICATION

Technician:
Christopher Coles

0b7633ae
Certification # _____

Notes:

SHEAR VALVE OPERATION INSPECTION

Facility Name: Speedway	Owner 7-Eleven Stores, Inc
Address: 504 West Main Street	Address
City, State, Zip Code: Palmyra NY 14522	City, State, Zip Code:
Facility I.D. #: 8-417572	Phone #: 3155973830
Testing Company: Owl Services USA	Phone #: 610-278-7203

This data sheet is for inspecting shear valves located inside dispensers. See PEI/RP1200 Section 10 for the inspection procedure.

Product Grade	Premium	Regular	Premium	Regular	Premium	Regular	Premium	Regular	
Dispenser ID#	1/2	1/2	3/4	3/4	5/6	5/6	7/8	7/8	
Shear ValveType (Product/Vapor)	Product	Product	Product	Product	Product	Product	Product	Product	
1. Is the shear valve rigidly anchored to the dispenser box frame or dispenser island?	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☐Yes ☐No
2. Is the shear section positioned between ½ inch above or below the top surface of the dispenser island?	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☐Yes ☐No
3. Is the lever arm free to move?	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☐Yes ☐No ☐NA
4. Does the lever arm snap shut the poppet valve?	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☐Yes ☐No ☐NA
5. Can any product be dispensed when the product shear valve is closed?	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☐No ☐NA
A "No" to Lines 1-4 or a "Yes" for Line 5 indicates a test failure.									
Test Results	☑Pass ☐Fail	☑Pass ☐Fail	☑Pass ☐Fail	☑Pass ☐Fail	☑Pass ☐Fail	☑Pass ☐Fail	☑Pass ☐Fail	☑Pass ☐Fail	☐Pass ☐Fail

Comments:

Tester's Name (print) Christopher Coles Tester's Signature Chris Cole 5/14/2026

Testing was conducted in accordance with PEI/RP1200

AUTOMATIC TANK GAUGE OPERATION INSPECTION

Facility Name: Speedway		Owner: 7-Eleven Stores, Inc	
Address: 504 West Main Street		Address:	
City, State, Zip Code: Palmyra NY 14522		City, State, Zip Code:	
Facility I.D. #: 8-417572		Phone #: 3155973830	
Testing Company: Owl Services USA		Phone #: 800-646-3161	Date: 5/14/2026

This procedure is to determine whether the automatic tank gauge (ATG) is operating properly. See PEI/RP1200 Section 8.2 for the inspection procedure. This procedure is applicable to tank level monitor probes that touch the bottom of the tank when in place.

Tank Number	017A	017B		
Product Stored	Premium	Regular		
ATG Brand and Model	Veeder Root TLS-450 Plus	Veeder Root TLS-450 Plus		
1. Tank Volume, gallons	4643	11527		
2. Tank Diameter, inches	92	92		
3. The ATG probe was removed from the tank and inspected for damage and residual buildup.	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
4. Float moves freely on the stem without binding?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
5. Fuel float level agrees with the value programmed into the console?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
6. Water float level agrees with the value programmed into the console?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
7. Inch level from bottom of probe when 90% alarm is triggered.	81	81		
8. Inch level at which the overfill alarm activates corresponds with value programmed in the gauge?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
9. Inch level from the bottom when the water float first triggers an alarm.	2	2		
10. Inch level at which the water float alarm activates corresponds with value programmed in the gauge?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
If any answers in Lines 3, 4, 5, or 6 are "No," the system has failed the test.				
If internal ATG battery backup is present, was it functional per manufacturer's specifications. ☑ Yes ☐ No ☐ None				
Test Results	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail

Comments:

Tester's Name (print) Christopher Coles

Tester's Signature



LIQUID SENSOR FUNCTIONALITY TESTING

Facility Name: Speedway				Owner: 7-Eleven Stores, Inc			
Address: 504 West Main Street				Address:			
City, State, Zip Code: Palmyra NY 14522				City, State, Zip Code:			
Facility I.D. #: 8-417572				Phone #: 3155973830			
Testing Company: Owl Services USA				Phone #: 800-646-3161		Date: 5/14/2026	
This procedure is to determine whether liquid sensors located in the interstitial space of UST systems are able to detect the presence of water and fuel. See PEI/ RP1200 Section 8.3 for the test procedure.							
Sensor Location	017A STP Sump	017B STP Sump					
Product Stored	Premium	Regular					
Type of Sensor	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating
Test Liquid	☑ Water ☐ Product	☑ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product
Is the ATG console clear of any active alarms regarding any leak sensors? If the sensor is in alarm and functioning, indicate why.	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Is the sensor alarm circuit operational?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Has sensor been inspected and in good operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When placed in the test liquid, does the sensor trigger an alarm?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When an alarm is triggered, is the sensor properly identified on the ATG console?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Any "No" answers indicates a test failure.							
Test Results	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail
Comments:							

Tester's Name (print) Christopher Coles Tester's Signature 

LIQUID SENSOR FUNCTIONALITY TESTING

Facility Name: Speedway		Owner: 7-Eleven Stores, Inc	
Address: 504 West Main Street		Address:	
City, State, Zip Code: Palmyra NY 14522		City, State, Zip Code:	
Facility I.D. #: 8-417572		Phone #: 3155973830	
Testing Company: Owl Services USA		Phone #: 800-646-3161	Date: 5/14/2026

This procedure is to determine whether liquid sensors located in the interstitial space of UST systems are able to detect the presence of water and fuel. See PEI/RP1200 Section 8.3 for the test procedure.

Sensor Location	017A Tank Interstitial	017B Tank Interstitial					
Product Stored	Premium	Regular					
Type of Sensor	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating
Test Liquid	☑ Water ☐ Product	☑ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product
Is the ATG console clear of any active alarms regarding any leak sensors? If the sensor is in alarm and functioning, indicate why.	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Is the sensor alarm circuit operational?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Has sensor been inspected and in good operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When placed in the test liquid, does the sensor trigger an alarm?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When an alarm is triggered, is the sensor properly identified on the ATG console?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Any "No" answers indicates a test failure.							
Test Results	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail

Comments:

Tester's Name (print) Christopher Coles Tester's Signature Chris Cole

Crompco LLC
1815 Gallagher Rd
Plymouth Meeting, PA 19462

7-Eleven Stores, Inc
Location #45098

504 West Main Street
Palmyra, NY 14522
+1 315-597-3830

Veeder Root TLS-450 PLUS Software Upgrade

SECTION 1

Did you complete the TLS-450 PLUS software update?

Yes

ATTACHMENTS

Photo of the Veeder Root TLS-450 PLUS screen showing the new software version?

Did you verify that the monitor equipment in Work Fossa is a TLS-450 PLUS console?

Yes

ATTACHMENTS

Enter the serial number of the ATG here. Also, confirm that the correct serial number is in the monitor equipment in the Work Fossa system.

Y09291876514005

ATTACHMENTS

Crompco LLC
1815 Gallagher Rd
Plymouth Meeting, PA 19462

7-Eleven Stores, Inc
Location #45098

504 West Main Street
Palmyra, NY 14522
+1 315-597-3830

Diagram - Site Diagram (v1)

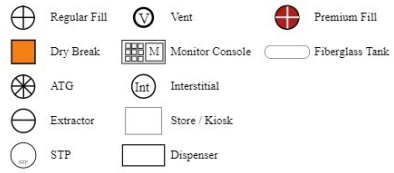

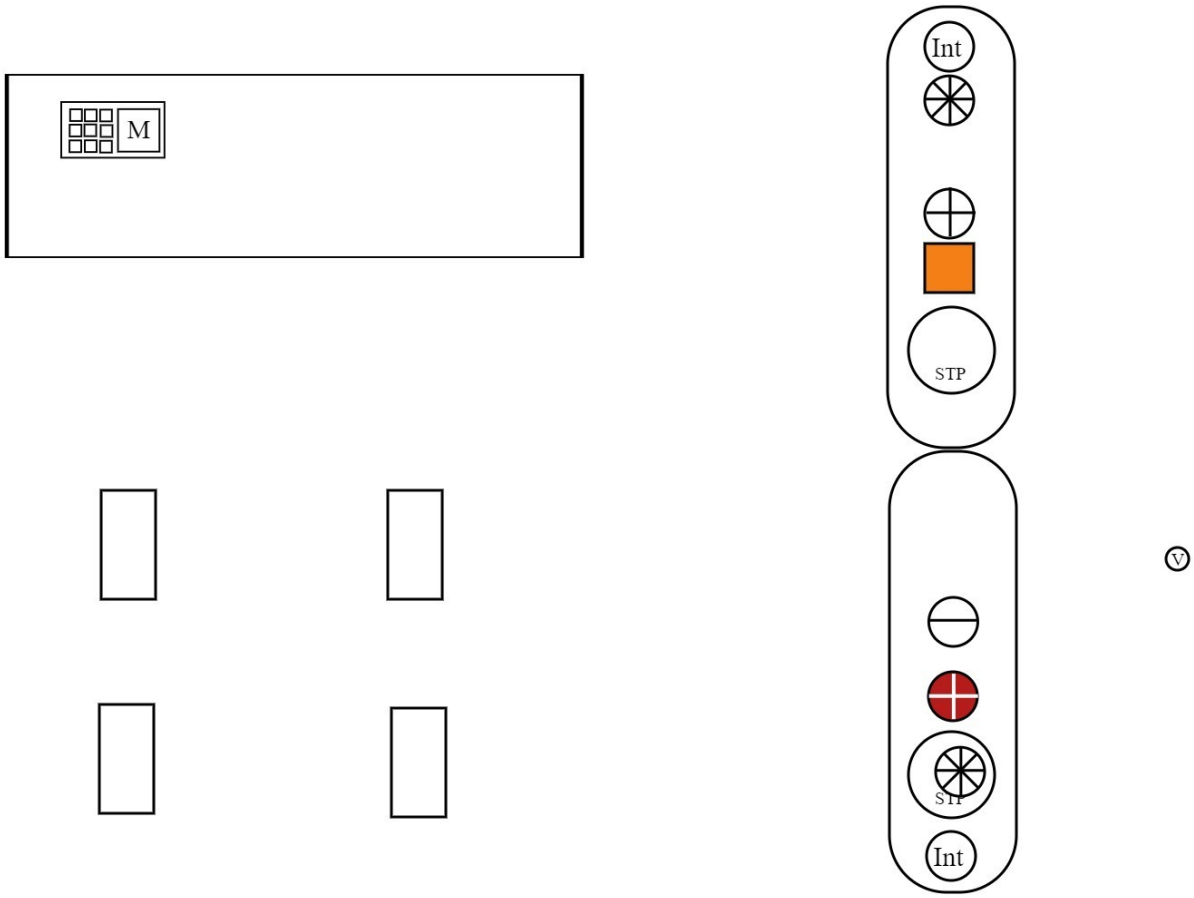

Visit Verification

CUSTOMER
7-Eleven Stores, Inc

LOCATION
#45098
504 West Main Street
Palmyra, NY 14522

CONTACT
7-Eleven Stores, Inc

SCHEDULED
05/14/2026 12:00am (EDT)

ASSIGNED TO
Brian Burch, Christopher Coles

SERVICE REASON
Compliance

PRODUCTS & SERVICES

Item	Qty
Combos	
All Lines and Leak Detectors	2.00
Expenses	
Fuel Surcharge	1.00
Services	
Monitor System Inspection Automatic Tank Gauging System / Monitor System Inspection	1.00
All Shear Valves	2.00
Emergency Stop Inspection	1.00
Veeder Root TLS-450 PLUS Software Upgrade	1.00

CONFIRMATION
By signing this verification you are agreeing that we have performed and/or provided services and parts listed above.

Approver's Name
N/A

Email

Signature Status
Nobody available to sign