2025-2026 Periodic Review Report
(Reporting Period: August 01, 2025 to August 01, 2026)

Location:

Bern Metal Corporation
22 Bender Avenue, City of Buffalo, New York
NYSDEC Site No. 915135

Prepared for:

City of Buffalo
Office of Strategic Planning
Division of Environmental Affairs
65 Niagara Square Room 901
Buffalo, New York 14202

LaBella Project No. 2254330

September 2026

Olympic Towers, 300 Pearl Street, Suite 130 | Buffalo, NY 14202 | p 716-551-6281 | f 716-551-6282
www.labellapc.com

Table of Contents

1.0 EXECUTIVE SUMMARY 3
1.1 Site Summary 3
1.2 Effectiveness of Remedial Program 3
1.3 Non-Compliance 3
1.4 Recommendations 3
2.0 SITE OVERVIEW 4
2.1 Site Background 4
3.0 EFFECTIVENESS OF THE REMEDIAL PROGRAM 4
4.0 INSTITUTIONAL/ENGINEERING CONTROLS (IC/EC) 5
4.1 Institutional Control Requirements and Compliance 5
4.2 Engineering Control Requirements and Compliance 5
4.2.1 Site Cover System 5
4.2.2 Site Access Controls 6
5.0 SITE MONITORING AND MAINTENANCE PROGRAM 6
5.1 Site Inspection and Certification 6
5.1.1 Site-Wide Inspection 6
5.1.2 IC/EC Certification 7
5.2 Groundwater Monitoring 7
6.0 CONCLUSIONS AND RECOMMENDATIONS 7
7.0 LIMITATIONS 7
8.0 REFERENCES 8

Figures
Figure 1 – Site Location Map
Figure 2 – Site Map
Figure 3 – Cover System Limits & Drainage Features
Engineering Plan Sheet 6: Cover System Details

Appendix 1 Post-Closure Inspection Form
Appendix 2 Photographs
Appendix 3 Site Management Periodic Review Report-Institutional and Engineering Controls Certification Form

1.0 EXECUTIVE SUMMARY

This Periodic Review Report (PRR) is a required element of the approved Operation, Maintenance and Monitoring (OM&M) Plan for 22 Bender Avenue (Former Bern Metal Corporation Site) in the City of Buffalo, Erie County, New York (hereafter referred to as the "Site"). This PRR was prepared on behalf of the City of Buffalo to summarize the post remedial status of New York State Department of Environmental Conservation (NYSDE) Site No. 915135. This PRR and associated Institutional and Engineering Controls (IC/EC) Certification Form have been completed for the post-remedial activities at the Site for the reporting period from August 1, 2025 to August 1, 2026.

1.1 Site Summary

The Site encompasses approximately 3.05 acres, located at 22 & 23 Bender Avenue, and 1021 Clinton Street in the City of Buffalo, Erie County, New York. The Site was an abandoned scrap reprocessor. The NYSDEC conducted a Phase I investigation in 1987 that identified approximately 200 55-gallon drums on the property, along with other wastes including: metal turnings, waste chemicals, sludges, battery cases, and spilled battery acids. In 1990 the United States Environmental Protection Agency (USEPA) conducted an emergency removal at the Site. From 1994 to 1995 a Remedial Investigation and Feasibility Study (RI/FS) was completed at the Site. A Record of Decision (ROD) was signed in 1996 which required contaminated soils be consolidated and properly capped. Under a New York State consent order, the waste was consolidated and capped on the property known as Bern Metals, in 2002. An OM&M Plan was prepared by Blasland Bouck & Lee, Inc., (BBL) dated May 2003. The long-term operation, maintenance, and monitoring is in effect and is being implemented by the City of Buffalo. Additionally, an OM&M addendum was submitted in 2022, outlining the frequency period updates and changes to the previous OM&M.

1.2 Effectiveness of Remedial Program

Based on a recent inspection of the Site, the Site cover system is intact, and the remedial program appears to be functioning as designed on the Site.

1.3 Non-Compliance

No areas of non-compliance regarding the major elements of the OM&M Plan were identified during the preparation of this PRR.

1.4 Recommendations

Overall, the remedial program is viewed to be effective in achieving the remedial objectives for the Site. No changes to the OM&M Plan or the frequency of PRR submissions are recommended at this time.

2.0 SITE OVERVIEW

The Site encompasses approximately 3.05 acres and is located at 22 and 23 Bender Avenue in the City of Buffalo, Erie County, New York (see Figure 1). As shown in Figure 2, the Site is bounded by Norfolk Southern railroad tracks to the west and south, Laub International to the east, and commercial, residential and vacant properties to the north. The Site is currently a vacant grass covered landfill. Figure 2 depicts the Site boundaries overlain on a current aerial image.

2.1 Site Background

The Site previously consisted of two properties known as: Bern Metals (approximately 3.05 acres) and Universal Metals (approximately 1.5 acres). The Site was an abandoned scrap reprocessor. Based on complaints from citizens, the NYSDEC conducted a Phase I Investigation in 1987. Approximately 200 55-gallon drums were found on the Bern Metals property, along with other wastes including metal turnings, waste chemicals, sludges, battery cases, and spilled battery acids. Subsequently, 25 leaking transformers containing PCBs were found on the Universal Metals property. The Site contaminants of concern included PCBs, chromium, lead, copper, and mercury prior to remediation.

In 1990 the USEPA conducted an emergency removal at the Site. Drums, gas cylinders, and transformers were removed from the Site. Under order of the USEPA in 1994, a group of potentially responsible parties (PRPs) remediated neighboring residential properties and erected a fence around the contaminated Site. The PRPs conducted a RI/FS of the Site during the period from 1994 to 1995.

The ROD was signed in 1996 which required the contaminated soils be consolidated and properly capped. Under a separate New York State consent order, the PRPs consolidated and capped the waste onto the property known as Bern Metals (approximately 3.05 acres), completing the project in 2002. An OM&M Plan was prepared in accordance with Section 5 of Final Design Report (FDR) prepared by (BBL) dated October 1998, and was required by Consent Decree No.02-CV-0277, which was entered by the United States District Court for the Western District of New York on July 19, 2002. The long-term OM&M Plan is in effect and is being implemented by the City of Buffalo. The Universal Metals property has been remediated as required by the ROD.

3.0 EFFECTIVENESS OF THE REMEDIAL PROGRAM

As detailed below in Section 5.1.1, the Site cover system, stormwater drainage system, and perimeter fence at the Site were inspected during the annual periodic review conducted August 20, 2026. Based on this inspection, the engineering controls are generally intact and functioning effectively; the cover system is intact and functioning effectively throughout the Site.

4.0 INSTITUTIONAL/ENGINEERING CONTROLS (IC/EC)

4.1 Institutional Control Requirements and Compliance

In accordance with the OM&M Plan, a series of Institutional Controls (ICs) have been established for the Site in the form of Site restrictions. Adherence to these ICs is required by the OM&M Plan and include the following:

- Groundwater use restrictions;
- Implementation of the OM&M Plan.

The maintenance, monitoring, inspection and reporting of all components of the remedy was performed as defined in the OM&M Plan and compliance with the above ICs was achieved.

4.2 Engineering Control Requirements and Compliance

Engineering Controls (ECs) have been established for the Site including a cover system and access restrictions in the form of perimeter fencing.

4.2.1 Site Cover System

Exposure to remaining contamination in soil/fill at the Site is prevented by a cover system that was previously placed over the Site. The approximate limits of the cover system are depicted on Figure 3. The cover system details are depicted on Engineering Plan Sheet 6 from the Final Design Report included in the Figures Appendix. The cover system is a permanent control, quality, and integrity of this system, and is inspected on an annual basis. The frequency of inspections will not change without the prior approval of the NYSDEC. The need for maintenance and repairs of the final cover system, sides, slopes, and stormwater drainage systems will be evaluated during the routine inspections. The purpose of these inspections is to confirm the final closure measures taken to limit stormwater infiltration and to prevent the migration of contaminant are operating as intended. The overall integrity of the final cover system on the Site will be assessed during inspections. Final cover maintenance and repair will be required if an inspection reveals any of the following conditions:

- Settlement /subsidence relative to the surrounding areas;
- Topsoil erosion;
- Cracking of the final cover system;
- Ponding of stormwater;
- Vehicle ruts;
- Exposed or damaged geosynthetic cover components;
- Animal burrows;
- Vegetative distress;
- Loss of vegetation due to traffic, drought, or excessive moisture; or
- Weed, brush or tree development.

The inspections will include observation of these conditions and other conditions that could be construed to be potentially detrimental to the function of the final cover system. Repairs will be performed at all areas exhibiting deficiencies or potential problems. Remedies can include additional soil cover or repair of cover as a result of erosion, settlement, cracking, ponding, or other similarly damaging conditions. Reseeding will be performed when a loss of vegetation is noted. Bush and tree seedlings will be removed upon discovery to prevent disruption of the final cover system.

The condition of the stormwater drainage system for the final cover system is assessed as part of the inspection and maintenance activities for the final cover system. Components of the stormwater drainage system include: mid-slope drainage swales; perimeter drainage ditches; and outlet drainage ditches. The Site drainage features are depicted on Figure 3. The stormwater components will be inspected for worn or

degraded vegetation, settlement, ponding, channel erosion or breach, and displaced rip-rap. In areas where inspections indicate a decrease in the performance of drainage system components, steps will be taken to restore proper flow. Maintenance of the stormwater drainage system may include removing sediment and/or vegetation from the drainage structures. Reconstructing and/or adding drainage features may also be required if excessive erosion takes place.

4.2.2 Site Access Controls

Access controls at the facility include fencing around the Bern Metal property and a gate located at the end of Bender Avenue. The chain link fence as well as the gate will be inspected for structural integrity and signs of vandalism and/or tampering. Repairs, if necessary, will be performed following inspections. The access gate will be checked to verify the latch assembly and lock are in place.

5.0 SITE MONITORING AND MAINTENANCE PROGRAM

5.1 Site Inspection and Certification

This PRR provides the information necessary to document the IC/EC certification. The certification primarily consists of a Site inspection to complete the NYSDEC "Site Management Periodic Review Report Notice-Institutional and Engineering Controls Certification Form" and confirm the IC/ECs:

- Are in place, performing properly, and remain effective;
- Nothing has occurred that would impair the ability of the controls to protect the public health and environment;
- Nothing has occurred that would constitute a violation or failure to comply with any operation and maintenance plan for such controls; and
- That access is available to the Site to evaluate continued maintenance of such controls.

The Site inspection includes the inspection of the following components in accordance with the OM&M Plan.

- Final cover system;
- Stormwater drainage system;
- Site access controls; and
- Site monitoring wells.

5.1.1 Site-Wide Inspection

Annual Site-wide inspections of the Site are required per the OM&M Plan. The annual inspection was conducted by LaBella on August 20, 2026, which included traversing the Site on foot to observe current conditions. The Site is vacant and undeveloped, with vegetated soil cover at the ground surface. At the time of the Site inspection the vegetative cover was observed to be in good condition and cover system intact. Four (4) animal burrowing holes were observed primarily along the eastern side of the Site with an additional fifth burrow located closer to the top of the landfill near the western side. Erosion, vehicle ruts, ponding water and protruding objects were not observed. The site cover is mowed annually. To accommodate the periodic review report schedule and to facilitate the annual site inspection, the site was mowed in July. The mowing of the site prior to September does not appear to adversely impact the cover system.

The stormwater drainage system was observed to be in good condition and functioning as intended. Inspection of the stormwater drainage system revealed growth of heavy vegetation within the perimeter drainage ditch and swales.

The access gate was generally observed to be intact and functioning as intended. The fencing was observed in good condition around the perimeter of the Site, with the repairs from the previous inspection remaining intact. Additionally, the Site monitoring wells were observed to be in good condition. The completed Post-Closure Inspection Form is included in Appendix 1. A photographic log showing the current condition of the Site is included in Appendix 2.

5.1.2 IC/EC Certification

The NYSDEC's IC/EC Certification Form was completed in its entirety as all ICs/ECs are in place for the Site per the OM&M Plan. Appendix 3 includes the NYSDEC "Site Management Periodic Review Report Notice-Institutional and Engineering Controls Certification Form."

5.2 Groundwater Monitoring

The OM&M Plan specified that during the first two years of the OM&M program, groundwater sampling would be performed on a semi-annual basis and the first two groundwater sampling events would include analysis of cadmium, chromium, lead, manganese, zinc, polychlorinated biphenyls (PCBs) and benzene, toluene, ethylbenzene, and xylenes (BTEX). After a review of the first two rounds of groundwater sampling data and as approved by the NYSDEC, the analyses were reduced to lead analysis only. Following the first two years of groundwater sampling, the groundwater sampling frequency was reduced to annually. Subsequent the 2017 groundwater sampling event a recommendation was made to modify the groundwater monitoring frequency to quinquennially (every 5 years). NYSDEC approved the modification to the groundwater monitoring frequency on November 21, 2017. Groundwater sampling was not performed during the reporting period. Groundwater monitoring well locations are depicted on Figure 2. The next groundwater sampling event will be performed in 2027.

6.0 CONCLUSIONS AND RECOMMENDATIONS

Annual inspection of the Site was performed on August 20, 2026, by LaBella Associates, DPC as prescribed in the OM&M Plan. As a result of this inspection, LaBella has determined that the Site is in compliance with the elements of the OM&M Plan.

As reflected by the signed Institutional and Engineering Controls Certification Form (Appendix 3), LaBella has concluded that:

- The required EC/ICs are in place, are performing properly, and remain effective;
- The OM&M Plan is being implemented; and
- The remedy continues to be protective of public health and the environment.

LaBella recommends the following:

- No changes to the inspection, reporting or certification frequency prescribed for the Site;
- Vegetation from the perimeter drainage ditches should be removed; and
- Animal burrows should be filled in to prevent further damage to the cap.

7.0 LIMITATIONS

The conclusions presented in this report are based on information gathered in accordance with generally acceptable professional consulting principles and practices. All conclusions reflect observable conditions existing at the time of the Site inspection. Information provided by outside sources (individuals, agencies, laboratories, etc.) as cited herein, was used in the assessment of the Site. The accuracy of the conclusions drawn from this assessment is, therefore, dependent upon the accuracy of information provided by these

sources. Furthermore, LaBella is not responsible for the impacts of any changes in environmental standards, practices, or regulations subsequent to the performance of services.

This report is based upon the application of scientific principles and professional judgment to certain facts with resultant subjective interpretations. Professional judgments expressed herein are based upon the facts currently available with the limits of the existing data, scope of services, budget and schedule. To the extent that more definitive conclusions are desired by the Client than are warranted by the current available facts, it is specifically Labella's' intent that the conclusions and recommendations stated herein will be intended as guidance and not necessarily a firm course of action expect where explicitly stated as such. LaBella makes no warranties, expressed or implied including without limitation, warranties as to merchantability or fitness of a particular purpose. Furthermore, the information provided in this report is not to be construed as legal advice.

This assessment and report have been completed and prepared on behalf of and for the exclusive use of City of Buffalo. Any reliance on this report by a third party is at such party's sole risk.

8.0 REFERENCES

DER-10/Technical Guidance for Site Investigation and Remediation, NYSDEC, May 3, 2010


Operation Maintenance, and Monitoring Plan, Bern Metal/Universal Metal Site Buffalo, New York; Blasland, Bouck &Lee, March 2003 (revised April 2003 and May 2003)

Operation Maintenance, and Monitoring Plan Addendum, Bern Metal Corporation Site; 22 Bender Avenue, Buffalo, New York; LaBella Associates, January 24, 2022

FIGURES

Path: I:\Buffalo, City of\2212554 - Multiple Sites Annual Monitoring\DIG\Maps\MXD\PRR\2021_08\Fig1_SiteLocation_Map.mxd

Creator: JR

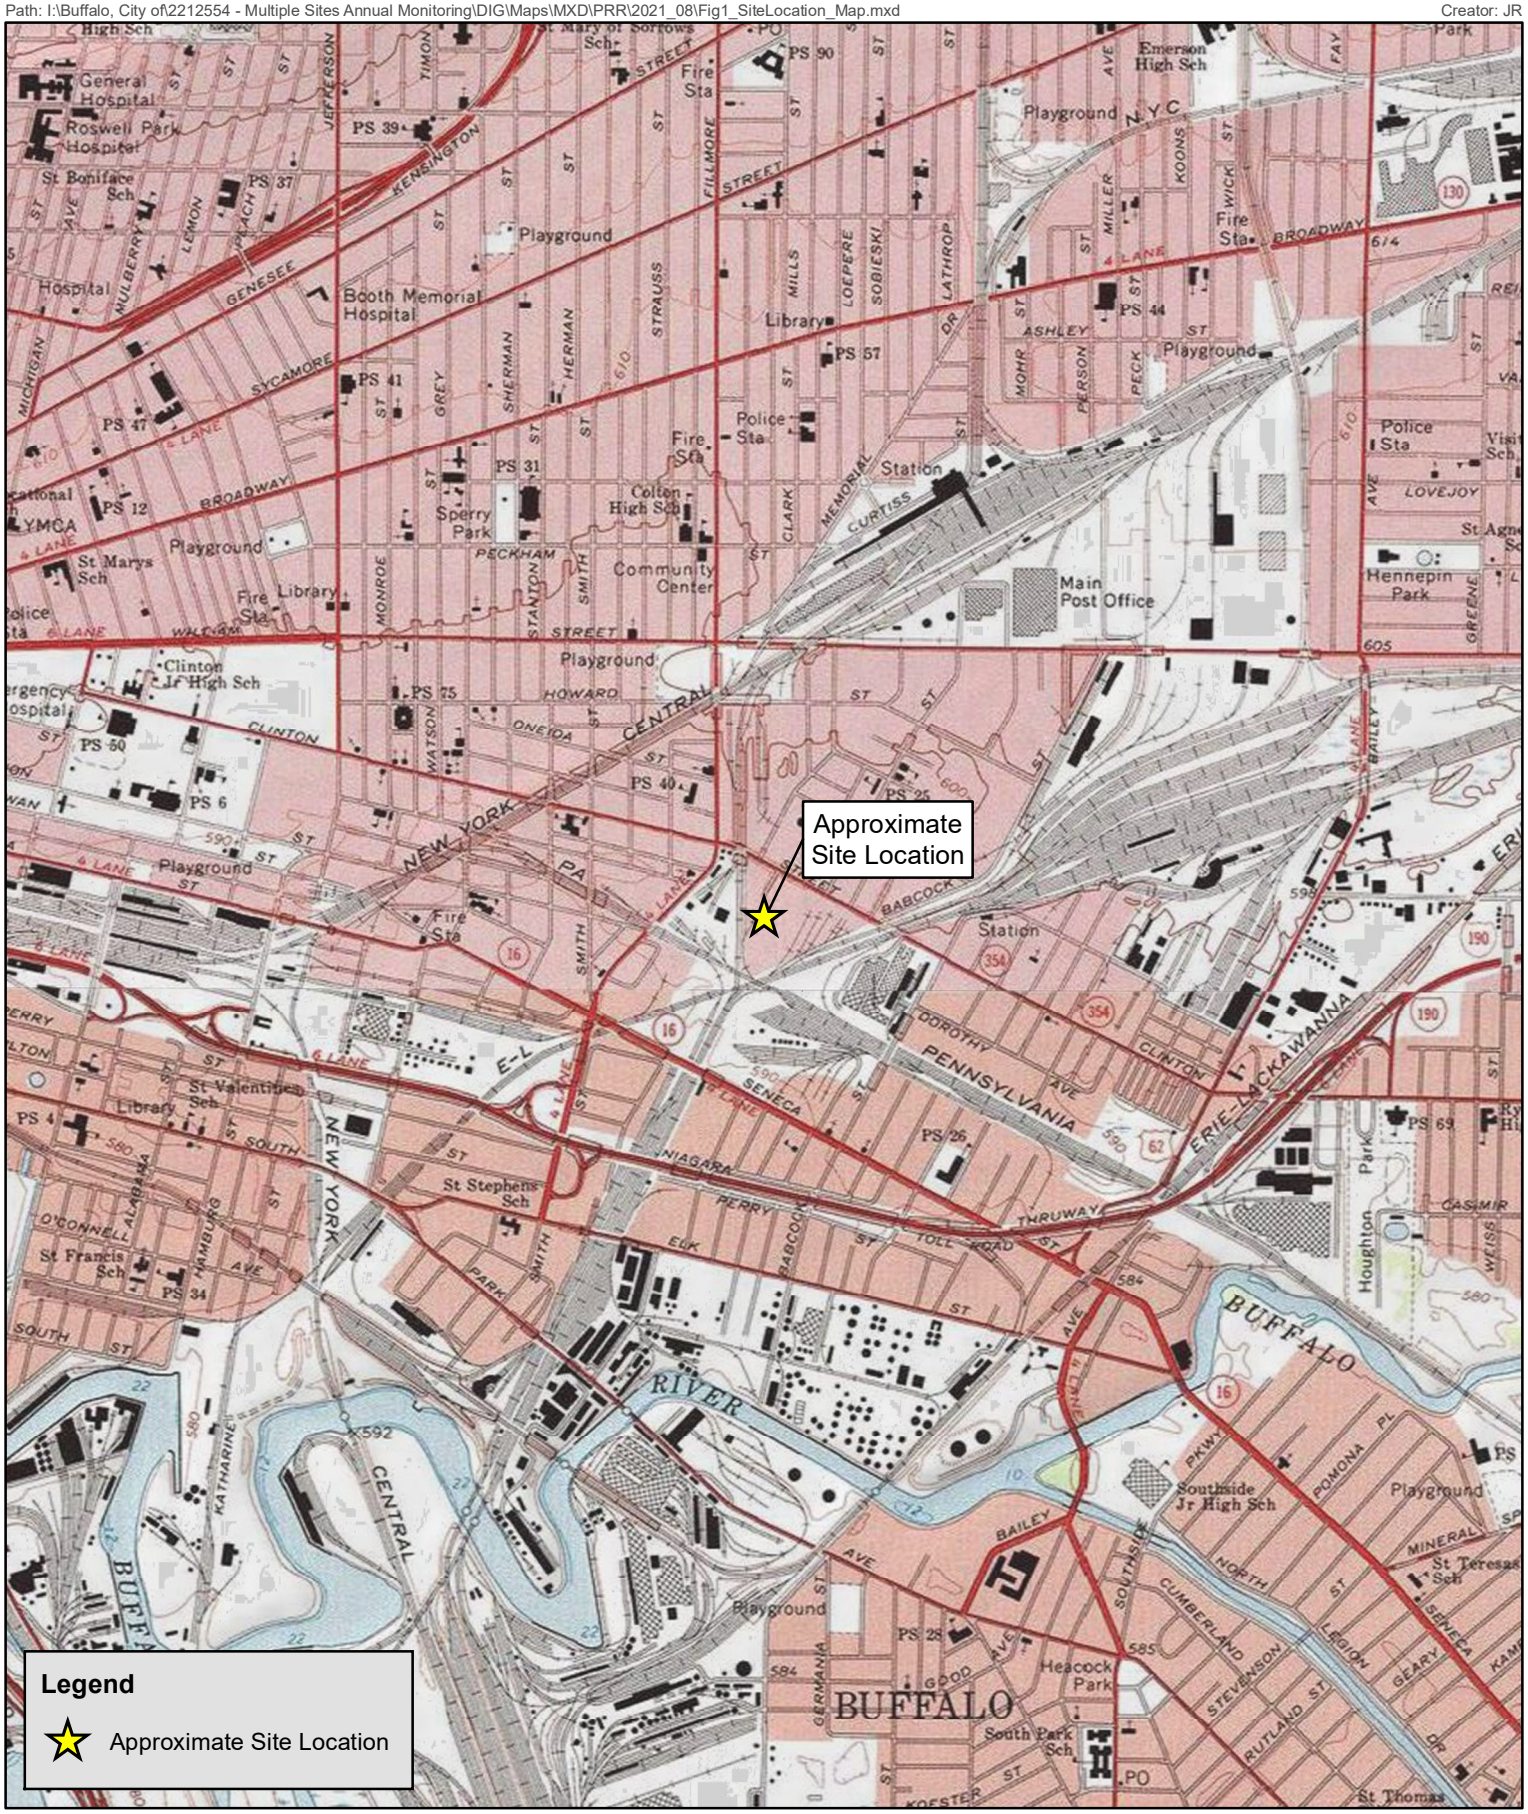

PROJECT # / DRAWING # / DATE:	DRAWING NAME:	PROJECT
2254330 **Figure 1** 8/20/2026	Site Location Map	2025-2026 Periodic Review Report 22 Bender Street, Buffalo, New York NYSDEC Site No. C915135

N

0 1,000 2,000 Feet

LaBella
Powered by partnership.

Data Source: Erie County 2020; LaBella 2021; USGS, National Geographic, i-cubed 2019.



PROJECT # / DRAWING # / DATE:
2254330
Figure 2
8/20/2026


DRAWING NAME:
Site Map

PROJECT:
2025-2026 Periodic Review Report
22 Bender Street, Buffalo, New York
NYSDEC Site No. C915135

N
0 50 100 Feet

LaBella
Powered by partnership.

Data Source: Bing Maps; Erie County, 2020; LaBella, 2024.

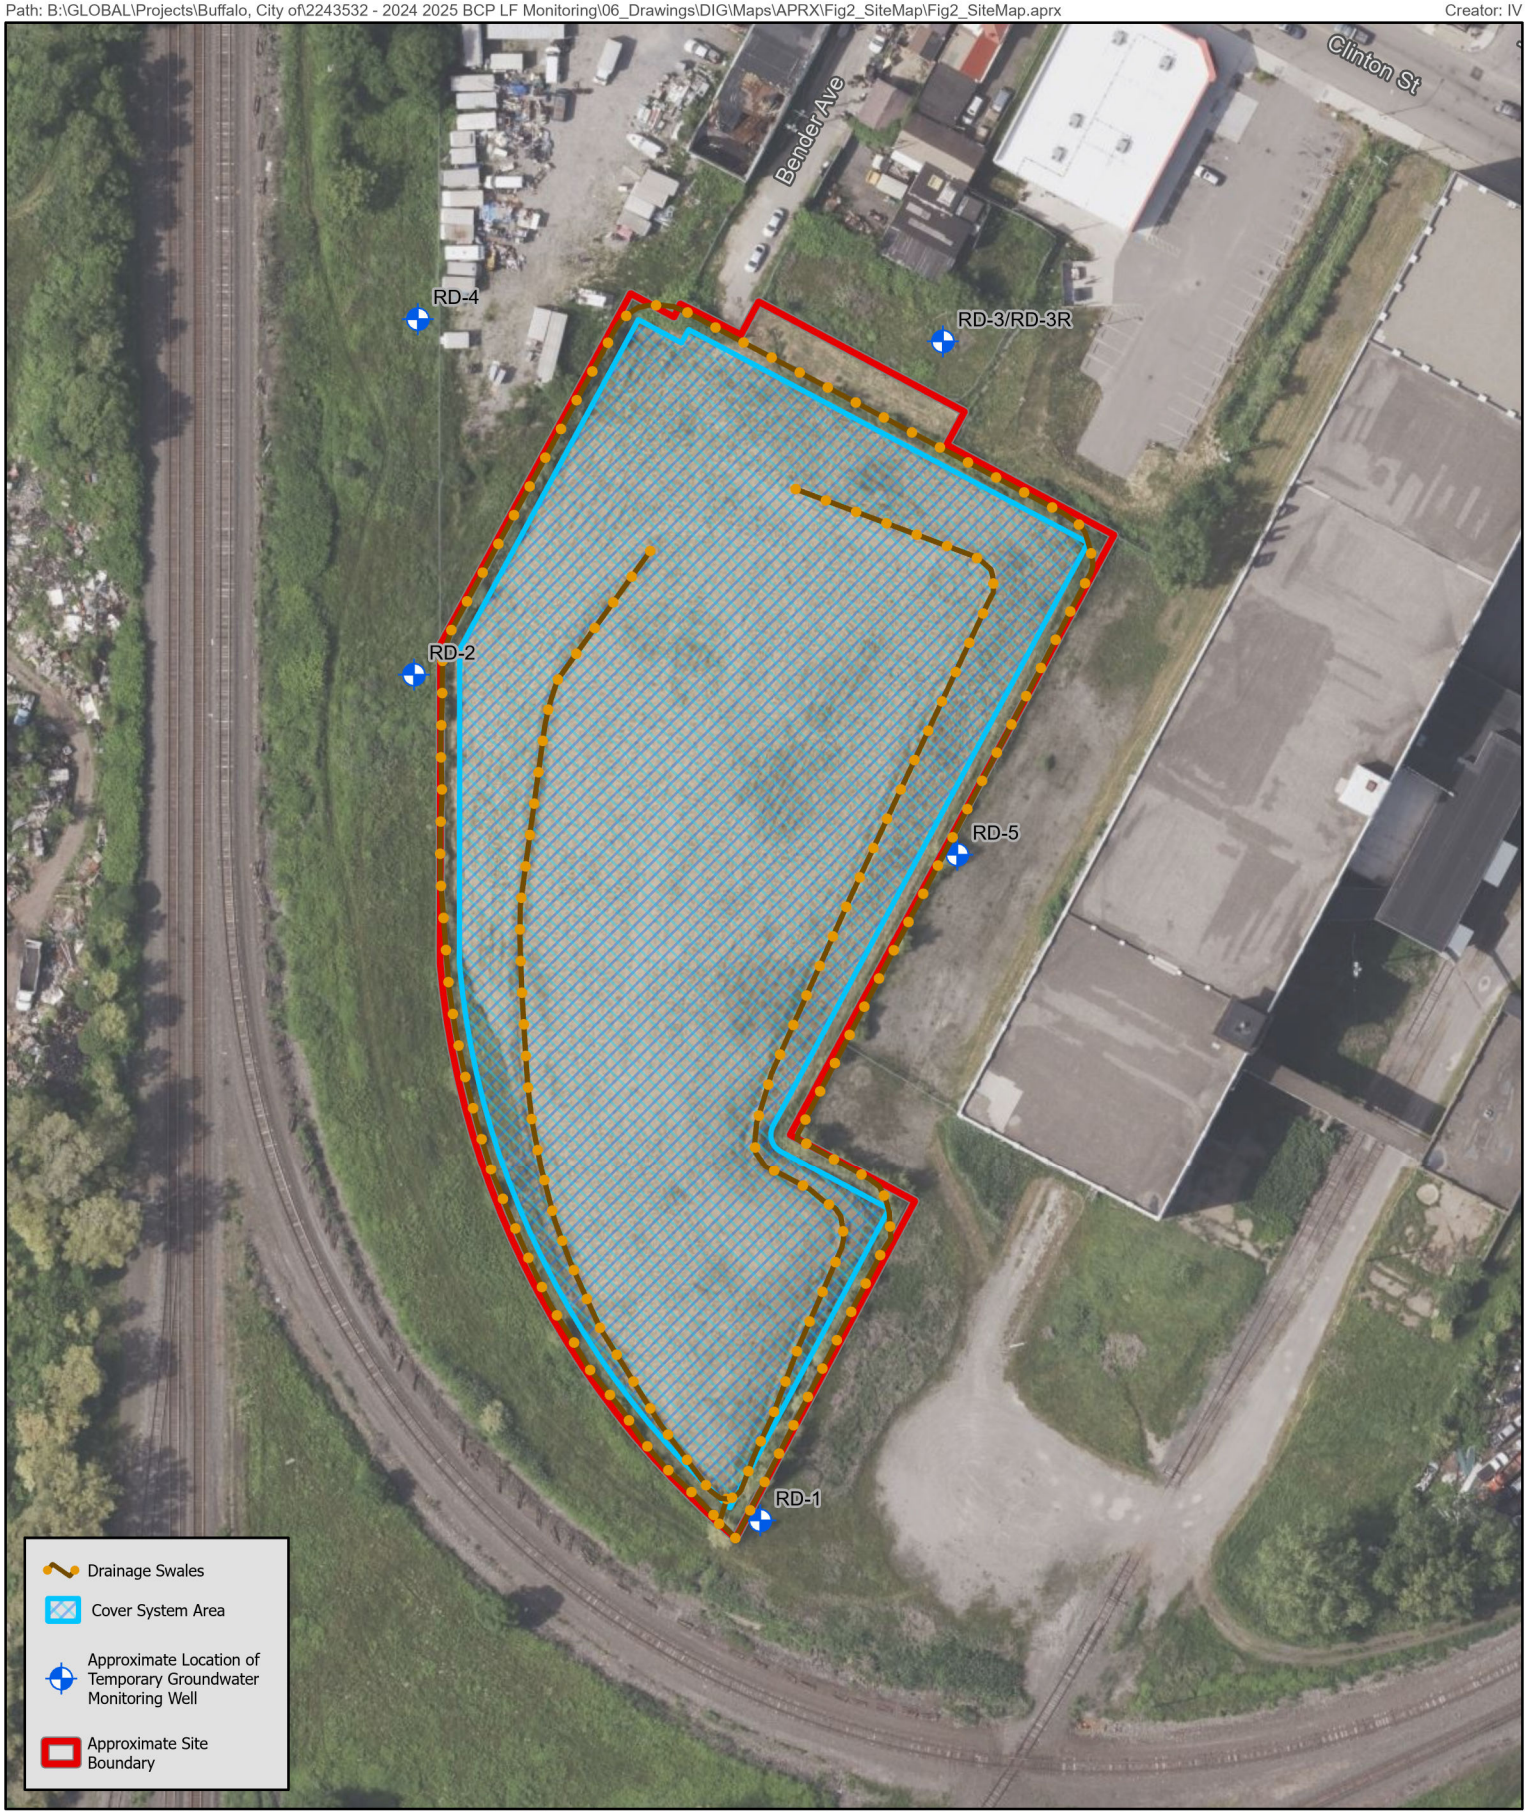

PROJECT # / DRAWING # / DATE:
2254330
Figure 3
8/20/2026


DRAWING NAME:
Cover System Limits & Drainage Areas

PROJECT:
2025-2026 Periodic Review Report
22 Bender Street, Buffalo, New York
NYSDEC Site No. C915135

N
0 50 100 Feet


LaBella
Powered by partnership.

Data Source: Bing Maps; Erie County, 2020; LaBella, 2024.

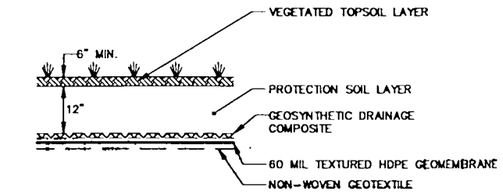


COVER SYSTEM 1

NOT TO SCALE

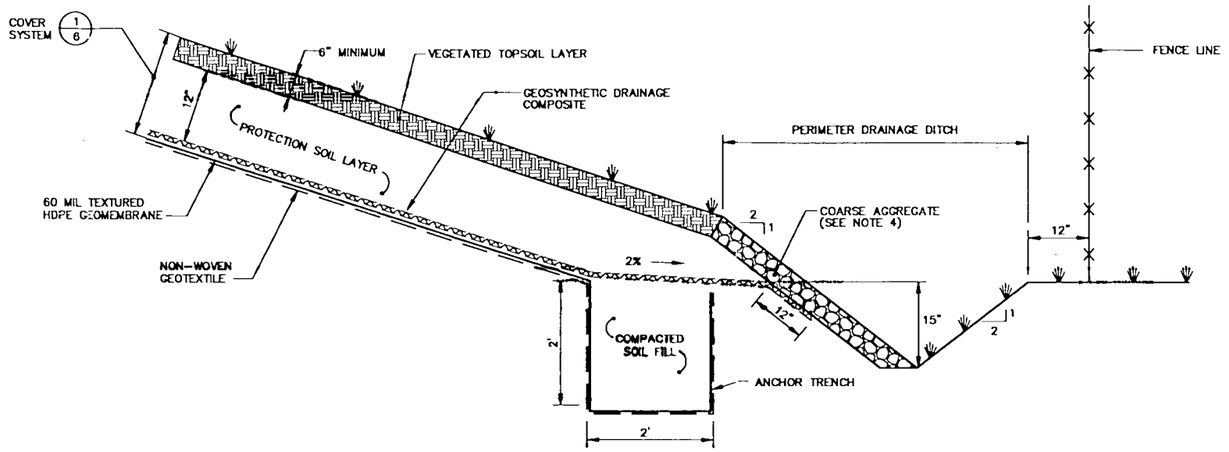


ANCHOR TRENCH/PERIMETER DRAINAGE DITCH 2

NOT TO SCALE

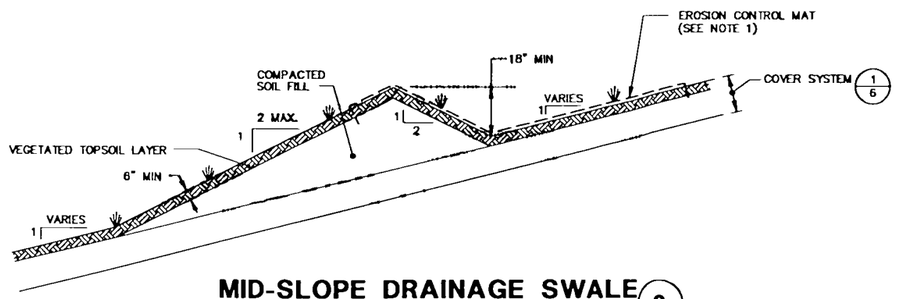

MID-SLOPE DRAINAGE SWALE 3

NOT TO SCALE

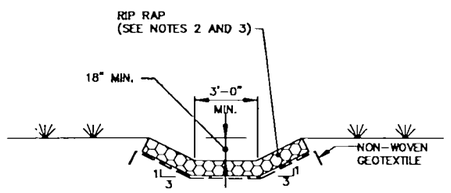

OUTLET DRAINAGE DITCH 4

NOT TO SCALE

NOTES:

1. EROSION CONTROL MAT SHALL BE NORTH AMERICAN GREEN SC150 OR EQUAL. EROSION CONTROL MAT SHALL BE INSTALLED IN ACCORDANCE WITH THE MANUFACTURER'S SPECIFICATIONS.
2. RIP RAP SHALL CONSIST OF CRUSHED STONE FREE FROM DELETERIOUS MATERIALS AND HAVE D_{50} = 6", AND D_{MAX} = 8".
3. ALL RIP RAP SHALL BE PLACED SECURELY IN A MANNER WHICH MINIMIZES VOID SPACES.
4. COARSE AGGREGATE SHALL BE NYSDOT 703-2 (4A) COARSE AGGREGATE.

X: NONE
L: ON=* OFF=*REF*
P: STD-PCP/DL
9/18/98 SYR-54-NES,KLN
77803003/77803G06.DWG

NOT TO SCALE

NO ALTERATIONS PERMITTED HEREON EXCEPT AS PROVIDED UNDER SECTION 7209 SUBDIVISION 2 OF THE NEW YORK STATE EDUCATION LAW

No.	Date	Revisions	Init

Project Mgr. _____
Designed by _____
Drawn by _____
Checked by _____
Prof. Eng. _____
PE License _____

BBL
BLASLAND, BOUCK & LEE, INC.
engineers & scientists

BERN METAL/UNIVERSAL SITE • BUFFALO, NEW YORK

REMEDIAL ACTION DESIGN REPORT

DETAILS

GENERAL

File Number
FILE NO.

Date
SEPTEMBER 1998

Blasland, Bouck & Lee, Inc.
Corporate Headquarters
6723 Towpath Road
Syracuse, NY 13214
315-446-9120

APPENDIX 1

Post-Closure Inspection Form

Post-Closure Inspection Form for Operation, Maintenance, and Monitoring
Bern Metal/Universal Metal Site
Buffalo, New York

Date: 8/20/2026
Weather: 67°F Overcast

Inspector(s): Gavin Krapidlowski

Gavin Krapidlowski

Inspection Items	Acceptable Yes	Acceptable No	Comments/Conditions
1. General Site Conditions			
Gates Locked and Secure	X		→ Hole repairs remain intact → perimeter → seen along gate entrance
Perimeter Fence/ Warning Signs	X		
Perimeter Vegetation	X		
Trash or Litter	X		
Survey Control Monuments	X		
2. Maintenance Road Condition			
Surface	X		
Accessability	X		
3. Final cover Vegetation			
General Grass Growth	X		→ Total of x5 located on site
Stressed Vegetation	X		
Animal Burrows	X		
Tree or Bush Growth	X		
Protruding Objects/Settlement	X		
Ponding Water	X		
Erosion	X		
4. Storm Water Drainage System			
Mid-Slope Drainage Swales	X		→ Prevalent vegitation growth observed along perimeter of site
Perimeter Drainage Ditch	X		
Outlet Drainage Ditch	X		
Catch Basins	X		
5. Groundwater Monitoring Wells			
Casings Secure and Locked	X		
6. Other Items			

Sketch


Project Name: Former Bern Metal Site Review 2026
Client: Bern Metals → City of Buffalo
LaBella Project No.: 2254330
Daily Field Notes

Sheet 2 of ____

DESCRIPTION OF WORK PERFORMED AND INSPECTION Item No., Sub-contractors (if any), Location and Nature of Work
• Document site conditions with pictures
• Complete Inspection form based on 2026 findings
• Record any abnormalities that were encountered while on site

SITE SKETCH

Direction: N / W + E / S

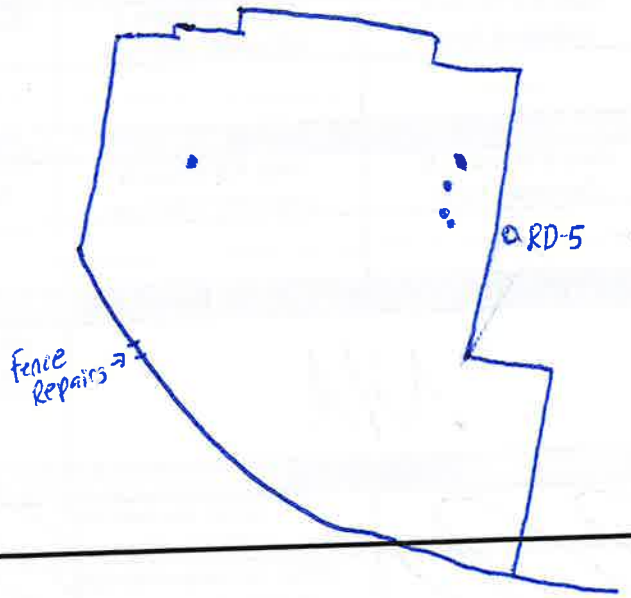

General outline of site
• : holes encountered while conducting survey

* Not to scale *

LaBella Field Rep Signature: _____ Date: 8/20/202

Attachments: Yes / No

APPENDIX 2

Photographs



Front Gate



Northern side of the Site (1)



Northern side of the Site (2)



Northeastern corner of the Site



Eastern view of the Site



Southeastern corner of the Site



Southeastern corner view facing across the Site



Southwestern corner view facing across the Site



View of Western side of Site facing South



View of Western side of Site facing North



Northwestern corner of the Site



Northwestern corner facing across the Site



Drainage swale from Eastern side of the Site



Drainage swale from the Western side of the Site



Animal Burrow – Eastern side of the Site



Animal Burrow (2) – Eastern side of the Site



Animal Burrow (3&4) – Eastern side of the Site



Animal Burrow (5) – Western side of the Site




Fencing



Repairs to hole in fencing



Monitoring Well RD-2

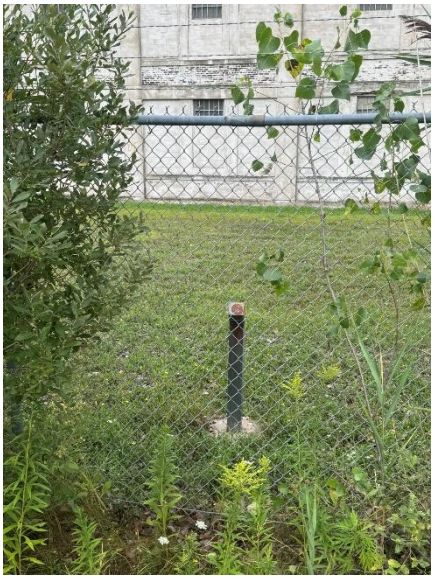

Monitoring Well RD-5

APPENDIX 3

Site Management Periodic Review Report Notice-Institutional and Engineering Controls Certification Form

Enclosure 2
NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION
Site Management Periodic Review Report Notice
Institutional and Engineering Controls Certification Form

Site Details **Box 1**

Site No. 915135

Site Name Bern Metal Corp.

Site Address: 22 Bender Avenue Zip Code: 14206
City/Town: Buffalo
County: Erie
Site Acreage: 3.049

Reporting Period: August 01, 2025 to August 01, 2026

	YES	NO
1. Is the information above correct?	☒	☐
If NO, include handwritten above or on a separate sheet.		
2. Has some or all of the site property been sold, subdivided, merged, or undergone a tax map amendment during this Reporting Period?	☐	☒
3. Has there been any change of use at the site during this Reporting Period (see 6NYCRR 375-1.11(d))?	☐	☒
4. Have any federal, state, and/or local permits (e.g., building, discharge) been issued for or at the property during this Reporting Period?	☐	☒
If you answered YES to questions 2 thru 4, include documentation or evidence that documentation has been previously submitted with this certification form.		
5. Is the site currently undergoing development?	☐	☒

Box 2

	YES	NO
6. Is the current site use consistent with the use(s) listed below? Closed Landfill	☒	☐
7. Are all ICs in place and functioning as designed?	☒	☐

IF THE ANSWER TO EITHER QUESTION 6 OR 7 IS NO, sign and date below and DO NOT COMPLETE THE REST OF THIS FORM. Otherwise continue.

A Corrective Measures Work Plan must be submitted along with this form to address these issues.

_____ _____
Signature of Owner, Remedial Party or Designated Representative Date

SITE NO. 915135 **Box 3**

Description of Institutional Controls

Parcel	Owner	Institutional Control
111.84-2-15.1	Mohammed Siddiqui	Ground Water Use Restriction O&M Plan

i) Implementation of Operation, Maintenance, and Monitoring Plan, dated May, 2003. ii) Prohibition of use of groundwater iii) Maintenance of fencing

111.84-2-16	Mohammed Siddiqui	Ground Water Use Restriction O&M Plan

i) Implementation of Operation, Maintenance, and Monitoring Plan, dated May, 2003. ii) Prohibition of use of groundwater iii) Maintenance of fencing

111.84-2-31	Damone Cannon	Ground Water Use Restriction O&M Plan

i) Implementation of Operation, Maintenance, and Monitoring Plan, dated May, 2003. ii) Prohibition of use of groundwater iii) Maintenance of fencing

Box 4

Description of Engineering Controls

Parcel	Engineering Control
111.84-2-15.1	Cover System Fencing/Access Control

i) Implementation of Operation, Maintenance, and Monitoring Plan, dated May, 2003.
ii) Prohibition of use of groundwater
iii) Maintenance of fencing

111.84-2-16	Cover System Fencing/Access Control
111.84-2-31	Cover System Fencing/Access Control

Box 5

Periodic Review Report (PRR) Certification Statements

1. I certify by checking "YES" below that:

   a) the Periodic Review report and all attachments were prepared under the direction of, and reviewed by, the party making the Engineering Control certification;

   b) to the best of my knowledge and belief, the work and conclusions described in this certification are in accordance with the requirements of the site remedial program, and generally accepted engineering practices; and the information presented is accurate and compete.

YES	NO
☒	☐

2. For each Engineering control listed in Box 4, I certify by checking "YES" below that all of the following statements are true:

   (a) The Engineering Control(s) employed at this site is unchanged since the date that the Control was put in-place, or was last approved by the Department;

   (b) nothing has occurred that would impair the ability of such Control, to protect public health and the environment;

   (c) access to the site will continue to be provided to the Department, to evaluate the remedy, including access to evaluate the continued maintenance of this Control;

   (d) nothing has occurred that would constitute a violation or failure to comply with the Site Management Plan for this Control; and

   (e) if a financial assurance mechanism is required by the oversight document for the site, the mechanism remains valid and sufficient for its intended purpose established in the document.

YES	NO
☒	☐

IF THE ANSWER TO QUESTION 2 IS NO, sign and date below and DO NOT COMPLETE THE REST OF THIS FORM. Otherwise continue.

A Corrective Measures Work Plan must be submitted along with this form to address these issues.

_____ _____

Signature of Owner, Remedial Party or Designated Representative Date

IC CERTIFICATIONS
SITE NO. 915135

Box 6

SITE OWNER OR DESIGNATED REPRESENTATIVE SIGNATURE

I certify that all information and statements in Boxes 1,2, and 3 are true. I understand that a false statement made herein is punishable as a Class "A" misdemeanor, pursuant to Section 210.45 of the Penal Law.

I Andrew Benkleman (print name) at LaBella Associates 300 Pearl St, Buffalo, NY (print business address).

am certifying as Owner Representative (Owner or Remedial Party)

for the Site named in the Site Details Section of this form.

Signature of Owner, Remedial Party, or Designated Representative Rendering Certification

6/25/26
Date

EC CERTIFICATIONS

Box 7

Professional Engineer Signature

I certify that all information in Boxes 4 and 5 are true. I understand that a false statement made herein is punishable as a Class "A" misdemeanor, pursuant to Section 210.45 of the Penal Law.

I Jared Pristach (print name) at LaBella Associates, 300 Pearl St., Buffalo, NY (print business address),

am certifying as a Professional Engineer for the Owner (Owner or Remedial Party)



Signature of Professional Engineer, for the Owner or Remedial Party, Rendering Certification	Stamp (Required for PE)	Date
		9/1/2026