Remedial Investigation Work Plan

Broadway Triangle Site C
Block 2269
Lots 25, 27, 28, 30, 31, 35, 36
59-69 Bartlett Street,
84-100 Throop Avenue,
90-100 Gerry Street
Brooklyn, New York 11206

July 30, 2021

Prepared for:

Unified Neighborhood Partners LLC
2 Kingsland Avenue
Brooklyn, New York 11211

Prepared by:

Roux Environmental Engineering and Geology, D.P.C.
209 Shafter Street
Islandia, New York 11749

3605.0001Y111/CV

Environmental Consulting
& Management
+1.800.322.ROUX
rouxinc.com

Table of Contents

Certification 1

1. Introduction 2
   - 1.1 Brownfield Cleanup Program Application and Environmental Work Plans 2
   - 1.2 RIWP Document Organization 2
   - 1.3 Project Team and Contact Information 2

2. Background 4
   - 2.1 Site Description and Setting 4
     - 2.1.1 Property Operations 4
     - 2.1.2 Utilities 5
     - 2.1.3 Topography 5
     - 2.1.4 Wetland Areas and Surface Water Bodies 5
     - 2.1.5 Soil and Underlying Formation 5
     - 2.1.6 Groundwater 5
     - 2.1.7 Neighboring Properties 5
   - 2.2 Site History 6
   - 2.3 Results of Previous Environmental Investigations 6
     - 2.3.1 Soil Quality 7
     - 2.3.2 Groundwater Quality 9
     - 2.3.3 Soil Vapor Quality 9
     - 2.3.4 Underground Storage Tanks 10
     - 2.3.5 NYSDEC Spill Incidents 10
     - 2.3.6 NYC OER E-Designations 10

3. RI Work Plan Objectives, Scope, and Rationale 11
   - 3.1 Objectives 11
   - 3.2 RI Scope 12
     - 3.2.1 Site Reconnaissance and Geophysical Survey 12
     - 3.2.2 Soil Investigation 12
     - 3.2.3 Groundwater Investigation 14
     - 3.2.4 Soil Vapor Investigation 15
     - 3.2.5 Investigation Laboratory Analysis 15
     - 3.2.6 Surveying Assessment 16
     - 3.2.7 Investigation Derived Waste 16
     - 3.2.8 Community Air Monitoring Plan 16
     - 3.2.9 Qualitative Exposure Assessment 16

4. Quality Assurance/ Quality Control (QA/QC) Protocols 17

5. Health and Safety 18

6. Reporting and Schedule 19

Table of Contents (Continued)

Figures

1. Site Location Map
2. Tax Map
3. Existing Conditions
4. Adjacent Property Owners and Surrounding Land Use
5. Soil Sample Locations and Exceedances
6. Groundwater Sample Locations and Exceedances
7. Soil Vapor Sample Locations and Detections
8. Proposed Remedial Investigation Sample Locations

Appendices

A. Historic Reports (Provided on Flash Drive in Bound Copy)
B. Quality Assurance Project Plan/Field Sampling Plan
C. Community Air Monitoring Plan
D. Site Specific Health and Safety Plan (Provided on Flash Drive in Bound Copy)

Certification

I, Jessica L. Taylor, certify that I am currently a Qualified Environmental Professional as defined in 6 New York Codes, Rules and Regulation (NYCRR) Part 375 and that this Remedial Investigation Work Plan was prepared in accordance with all applicable statutes and regulations and in substantial conformance with the DER-10 Technical Guidance for Site Investigation and Remediation, dated May 2010 (DER-10).

Jessica L. Taylor	7/30/2021	
Qualified Environmental Professional	Date	Signature

1. Introduction

Roux Environmental Engineering and Geology, D.P.C. (Roux), on behalf of Unified Neighborhood Partners, LLC (Applicant), has prepared this Remedial Investigation Work Plan (RIWP) for Broadway Triangle Site C (Site), located at 59-69 Bartlett Street, 84-100 Throop Avenue, and 90-100 Gerry Street in the Broadway Triangle section of Brooklyn, New York (Figure 1). The Site is comprised of Block 2269 and Lots 25, 27, 28, 30, 31, 35, and 36 of the New York City (NYC) Tax Map (Figure 2). Block 2269 Lots 29 and 33 are also included within the footprint of the planned redevelopment known as Throop Corners and are discussed throughout the text of this work plan; however, they are currently excluded from the BCP Site as they have not been deemed eligible for the BCP.

The Site encompasses an area of approximately 0.52 acres and will be investigated and properly addressed under the New York State Department of Environmental Conservation (NYSDEC) Brownfield Cleanup Program (BCP). The planned redevelopment of the Site entails the construction of a 9-story multifamily building consisting of 140 affordable housing units, a rooftop terrace accessible to residents, laundry room, children's playroom, community room, and bike storage. Additionally, 7,725 square feet will be dedicated as a workforce development office.

1.1 Brownfield Cleanup Program Application and Environmental Work Plans

Unified Neighborhood Partners, LLC has applied to the BCP as a Volunteer. The Applicant submitted an NYSDEC BCP application in April 2021 and was accepted into the program as a Volunteer in July 2021. The Brownfield Cleanup Agreement (BCA) was fully executed on July 28, 2021, and Site #C224324 was assigned to the Site. This RIWP was developed in accordance with the DER-10 Technical Guidance for Site Investigation and Remediation, dated May 2010 (DER-10).

The purpose of the Remedial Investigation (RI) is to determine the nature and extent of contamination at the Site, characterize environmental media, qualitatively assess the potential exposure of receptors to Site contaminants, and develop any other additional data necessary to support the development of a Remedial Action Work Plan (RAWP).

1.2 RIWP Document Organization

This RIWP contains a background section (Section 2) describing the Site, its history, and results of previous environmental investigations; a section defining the objectives and scope of the RI (Section 3); and Sections 4 and 5 that describe project operations plans (e.g., Quality Assurance/Quality Control, Health and Safety). Reporting requirements and the project schedule are discussed in Section 6. Figures are provided to illustrate Site conditions and the locations of proposed sampling efforts.

1.3 Project Team and Contact Information

This RI will be staffed by Roux personnel in the Islandia, New York office. Contact information and responsibilities for the key staffing is provided in the table below.

Personnel	Title	Contact Information
Jessica L. Taylor, P.G. Principal Hydrogeologist	Principal-In-Charge	(631) 232-2600 jtaylor@rouxinc.com

Personnel	Title	Contact Information
Charles J. McGuckin P.E. Vice President/Principal Engineer	Engineer of Record	(631) 232-2600 cmcguckin@rouxinc.com
Brandon Vella Project Scientist	Project Manager	(631) 232-2600 bvella@rouxinc.com
Emily Butler Project Geologist	Field Manager	(631) 232-2600 ebutler@rouxinc.com

Professional profiles are provided as an appendix to the Quality Assurance Project Plan/Field Sampling Plan.

The name and contact information for the Applicant is:

Drew E. Vanderburg
Unified Neighborhood Partners, LLC
2 Kingsland Avenue
Brooklyn, New York, 11211
718-366-3800 x 1039

Laboratory analytical services will be completed by Eurofins TestAmerica Laboratories of Edison, New Jersey and Burlington, Vermont. Data validation services will be completed by Senior Scientist Joshua Cope, of Roux Associates, Inc, who is independent from the project implementation team.

Drilling services will be performed by Land, Air, Water Environmental Services, Inc. of Center Moriches, New York. Surveying will be performed by Mega Engineering and Land Surveying, P.C. of Queens Village, New York. Off-Site transportation and disposal of investigation derived waste (IDW) will be performed by AARCO Environmental Services, Corp. of Lindenhurst, New York.

2. Background

This section provides pertinent background information, including a description of the Site and its setting, the history of the Site, and the results of the previous environmental work conducted at the Site.

2.1 Site Description and Setting

A Site Location Map and Tax Map are included as Figures 1 and 2, respectively.

Property Location	
Property Name:	Broadway Triangle Site C
Property Address:	59-69 Bartlett Street, 84-100 Throop Avenue, and 90-100 Gerry Street
Property Town, County, State:	Broadway Triangle area of Brooklyn, Kings County, New York
Property Tax Identification:	Block 2269 Lots 25, 27, 28, 30, 31, 35, and 36
Property Topographic Quadrangle:	USGS-Brooklyn, New York
Nearest Intersection:	Gerry Street to the north, Throop Avenue to the east, Bartlett Street to the south
Area Description:	The Site is a vacant, overgrown undeveloped lot with several patches of exposed concrete.

Property Information	
Property Size:	Approximately 0.52 acres
Property Use:	The property is currently vacant
Improvements:	None currently with exception of security fence enclosing entirety of Site.

Information regarding elevation, regional groundwater flow direction(s), Federal United States Geological Society (USGS) well information, Federal Reporting Data System (FRDS) Public Water Supply system information, and state database well information was derived from a Phase I Environmental Site Assessment (Phase I ESA), prepared by Environmental Business Consultants (EBC), dated November 6, 2019, a Remedial Investigation Report (RIR) prepared by Gallagher Bassett Technical Services (GBTS), dated June 2020, and a BCP Eligibility Soil Sampling Summary prepared by Roux dated March 8, 2021. Copies of these reports are provided in digital format on a flash drive as Appendix A.

2.1.1 Property Operations

The site is currently a vacant, fenced-in lot with no occupants. A map showing an aerial view of the existing conditions is provided as Figure 3.

2.1.2 Utilities

Based on limited visual observations made during the Site reconnaissance, no utilities appear to be in current use at the Site due to the lack of existing permanent structures. For future construction at the Site, it is assumed that Consolidated Edison will provide electric and natural gas services, and New York City Department of Environmental Protection (NYCDEP) will supply potable (drinking) water and sewer services.

2.1.3 Topography

According to the Phase I ESA, the topography of the site and surrounding area was reviewed from the USGS 7.5-minute series topographic map for the Brooklyn, NY Quadrangle. The land surface elevation is approximately 14 feet above mean sea level (amsl). The property is generally flat with the topographic gradient sloping downward to the northwest.

2.1.4 Wetland Areas and Surface Water Bodies

According to the Phase I ESA, the Site is not located in, or adjacent to, regulated wetlands within a one-mile radius of the property. The Site also is not located within the 100-year or 500-year flood zones. The nearest natural surface water body is Newtown Creek, located approximately 0.9 mile northeast of the Site, at its closest point.

2.1.5 Soil and Underlying Formation

Based on the information provided in the GBTS RIR, subsurface materials throughout the Site generally contain fill materials (unsorted sand, gravel, and debris [e.g., brick, ash, concrete, and glass]) to depths ranging from 6 to 11 feet below land surface (ft bls). No ash was reported in the shallow soil samples collected during the 2020 Roux BCP eligibility soil sampling event. Fill materials overlie native brown sandy silt with trace to some clay and gravel at the northern and eastern portions and brown clay with trace silt at the southern and western-central portions. The GBTS RIR reported no bedrock was encountered during drilling to a maximum depth of 18 ft bls, the total depth of exploration. Based on Roux's experience with other projects in the vicinity of the Site, the depth to bedrock is estimated to range from 160 to 200 ft bls.

2.1.6 Groundwater

Groundwater, when encountered, was generally between approximately 9 and 11 ft bls. Groundwater flow direction is likely influenced by subsurface utilities, lithology, and other subsurface features. For the purposes of assigning gradients, the assumed groundwater flow direction is southwest to northeast in the area of the Site.

2.1.7 Neighboring Properties

The area surrounding the Site mainly consists primarily of commercial and multi-family residential properties and vacant land. The Site is adjoined by the following: an unoccupied commercial/manufacturing building and a multi-family residential structure to the west; the United Talmudical Academy and Bartlett Playground to the south (across Bartlett Street); a multi-family residential structure and vacant, overgrown land to the north (across Berry Street); and a multi-family residential structure (formerly a filling station) to the east (across Throop Avenue). Adjacent property owners and land use descriptions for the surrounding area are shown in Figure 4.

2.2 Site History

Based on a review of Historic Sanborn fire insurance maps, aerial photographs, city directories, and New York City Assessor's and Building Department records, the following Site history was established. The Site was developed as early as 1887 with several commercial and residential structures (including several outbuildings). Commercial uses have included a tailor, undertakers, and a club. The southern-central portion of the Site was occupied by an automotive repair facility (65 Bartlett Street; Lot 35) from at least 1965 to 1989; no other significant on-Site commercial uses were noted. The Site has been vacant since circa 2008 when all buildings were demolished.

The eastern adjoining property located on the opposite side of Throop Avenue (currently a multi-family residential structure) was identified as a former gasoline filling station from at least 1935 to 1984. Several other nearby properties were identified as automotive repair facilities. All nine tax lots that comprise the Site are currently owned by NYC Housing Preservation and Development.

2.3 Results of Previous Environmental Investigations

This section provides an overview of previous environmental-related activities completed at the Site, based on a review of readily available information and the following environmental reports available for review:

- Phase I ESA prepared by EBC, dated November 6, 2019;
- RIR prepared by GBTS, dated June 2020; and
- BCP Eligibility Soil Sampling Summary, prepared by Roux, dated March 8, 2021.

The findings of the reports are summarized below, and copies of the reports are provided in Appendix A. Category B laboratory report deliverables are available for the previous investigation analytical data collected by Roux in December 2020 and summarized in the BCP Eligibility Soil Sampling Summary, and Data Usability Summary Reports (DUSRs) will be prepared when this data is incorporated into the Remedial Investigation Report (RIR).

Phase I ESA prepared by EBC, dated November 6, 2019

One recognized environmental condition (REC) was identified in connection with historic automotive repair activities at the Site (65 Bartlett Street, Lot 35). Two historic recognized environmental conditions (HRECs) were identified in connection with four removed underground storage tanks (USTs) and two minor closed NYSDEC spills at the Site. Several environmental concerns (ASTM Non-Scope issues and Business Environmental Risks [BERs]) were identified in connection with the potential presence of urban fill at the Site and E-Designations for noise and hazardous materials. Additional information about the Site's UST listings, spills, and E-Designations are provided in Sections 2.3.4 through 2.3.6, respectively.

RIR prepared by GBTS, dated June 2020

During the April 2020 GBTS remedial investigation, 37 soil samples were collected from nine soil borings (SB-01 through SB-09), groundwater samples were collected from three temporary groundwater monitoring wells (MW-01 through MW-03), and soil vapor samples were collected from six temporary soil vapor points (SV-01 through SV-06). Due to the presence of petroleum odors, staining, and elevated photoionization detector (PID) readings observed during soil boring advancement on Lot 27 GBTS notified NYSDEC and Spill No. 2001570 was reported on June 3, 2020. Additional information regarding NYSDEC Spill No. 2001570 is provided in Section 2.3.5.

Soil conditions at the Site were representative of impacted fill resulting from historic Site activities. Soil samples contained semivolatile organic compounds (SVOCs) and metals in exceedance of NYSDEC Restricted Residential Use Soil Cleanup Objectives (RRSCOs) and Unrestricted Use Soil Cleanup Objectives (UUSCOs). Groundwater beneath the Site exceeded NYSDEC Ambient Water Quality Standards and Guidance Values (AWQSGVs) for several SVOCs and metals. Soil vapor samples throughout the Site contained multiple petroleum-related volatile organic compounds (VOCs) and chlorinated volatile organic compounds (CVOCs).

BCP Eligibility Soil Sampling Summary, prepared by Roux, dated March 8, 2021

Roux conducted soil sampling on December 2020 on behalf of Unified Neighborhood Partners, LLC to further characterize shallow soil conditions at the Site. Seven soil borings (RXC-2801, RXC-2802, RXC-2901, RXC-2902, RXC-3101, RXC-3301 and RXC-3302) were advanced to collect shallow (0 to 5 ft bls) soil samples for analysis of SVOCs and metals. Based on the results of the soil eligibility sampling event, multiple SVOCs and metals were detected at concentrations exceeding their respective RRSCOs, which is characteristic of impacted fill.

No groundwater or soil vapor samples were collected at the Site during the Roux 2020 BCP eligibility investigation.

2.3.1 Soil Quality

The proposed Site redevelopment plan is to provide affordable multifamily housing; therefore, the available soil data was compared to the NYSDEC RRSCOs. Based on the proposed post-redevelopment Site use, soil exceedances of RRSCOs will serve as the threshold for the Site's eligibility for acceptance into the NYSDEC BCP. The presence of these contaminants must be remediated for the proposed restricted residential use development. As a result, the NYSDEC BCP will be an appropriate program to complete investigation and remediation to ensure the redevelopment is protective of the public health and the environment. As part of the NYSDEC BCP, the Site will undergo additional investigations to delineate the nature and extent of contaminants pursuant to this RIWP.

A summary of compounds detected in exceedance of NYSDEC RRSCOs and UUSCOs in all previous investigations is shown on Figure 5. A summary of the SVOC and metals RRSCO exceedances in soil is presented below. There were no RRSCOs exceedances for VOCs, pesticides, PCBs, or PFAS.

SVOCs

Laboratory analytical data for the exceedances of RRSCOs for SVOCs in soil are summarized below with the maximum concentration and location noted in **bold** text.

Analyte	Number of RRSCO Exceedances	Location of SCO Exceedance	Concentrations (mg/kg or ppm)	RRSCO (mg/kg or ppm)
Benzo(a)anthracene	4	**SB-02 (0-2 ft bls) – Lot 35** SB-03 (0-2 ft bls) – Lot 36 SB-04/MW-03 (0-2 ft bls) – Lot 36 RXC-3101 (0-2 ft bls) – Lot 31	**6.44** 3.33 4.74 1.1	1
Benzo(a)pyrene	4	**SB-02 (0-2 ft bls) – Lot 35** SB-03 (0-2 ft bls) – Lot 36 SB-04/MW-03 (0-2 ft bls) – Lot 36	**5.46** 2.9 5.07	1

Analyte	Number of RRSCO Exceedances	Location of SCO Exceedance	Concentrations (mg/kg or ppm)	RRSCO (mg/kg or ppm)
		RXC-3101 (0-2 ft bls) – Lot 31	1.2	
Benzo(b)fluoranthene	4	SB-02 (0-2 ft bls) – Lot 35 SB-03 (0-2 ft bls) – Lot 36 **SB-04/MW-03 – Lot 36** RXC-3101 (0-2 ft bls) – Lot 31	4.83 2.91 **5.14** 1.4	1
Benzo(k)fluoranthene	2	**SB-02 (0-2 ft bls) – Lot 35** SB-04/MW-03 (0-2 ft bls) – Lot 36	**4.12** 4.02	3.9
Chrysene	2	**SB-02 (0-2 ft bls) – Lot 35** SB-04/MW-03 (0-2 ft bls)– Lot 36	**6.02** 4.66	3.9
Dibenzo(a,h)anthracene	3	SB-02 (0-2 ft bls) – Lot 35 SB-03 (0-2 ft bls) – Lot 36 **SB-04/MW-03 (0-2 ft bls) – Lot 36**	1.13 0.533 **1.36**	0.33
Indeno(1,2,3-c,d)pyrene	6	SB-02 (0-2 ft bls) – Lot 35 SB-03 (0-2 ft bls) – Lot 36 **SB-04/MW-03 (0-2 ft bls) – Lot 36** SB-05/MW-02 (0-2 ft bls) – Lot 30 SB-06 (0-2 ft bls) – Lot 27 RXC-3101 (0-2 ft bls) – Lot 31	4.26 2.33 **4.37** 0.595 0.779 0.65	0.5

Metals

Laboratory analytical data for the exceedances of RRSCOs for metals in soil are summarized below with the maximum concentration and location noted in **bold** text.

Analyte	Number of RRSCO Exceedances	Location of SCO Exceedance	Concentrations (mg/kg or ppm)	RRSCO (mg/kg or ppm)
Arsenic	1	**SB-06 (0-2 ft bls) – Lot 27**	**18.3**	16
Barium	3	**SB-04/MW-03 (0-2 ft bls) – Lot 35** SB-06 (0-2 ft bls) – Lot 27 SB-07 (5-7 ft bls) – Lot 25	**1570** 910 1530	400
Lead	5	SB-02 (0-2 ft bls) – Lot 35 SB-06 (0-2 ft bls) – Lot 27 **SB-07 (5-7 ft bls) – Lot 25** SB-08 (0-2 ft bls) – Lot 25 RXC-2802 (0-2 ft bls) – Lot 28	489 777 **2050** 441 460	400
Mercury	6	SB-02 (0-2 ft bls) – Lot 35 SB-02 (5-7 ft bls) – Lot 35 SB-03 (0-2 ft bls) – Lot 36 **SB-07 (5-7 ft bls) – Lot 25** SB-08 (0-2 ft bls) – Lot 25 RXC-3101 (0-2 ft bls) – Lot 31	2.34 3.17 1.27 **4.92** 0.896 1.1	0.81

2.3.2 Groundwater Quality

A summary of compounds detected in exceedance of AWQSGVs in all previous investigations is shown on Figure 6. A summary of available groundwater analytical data for the Site is presented below.

VOCs: No VOCs were detected at concentrations exceeding AWQSGVs.

SVOCs: Of the monitoring wells sampled, only one location (MW-01) had detections of SVOCs, specifically PAHs, exceeding their respective AWQSQVs. These compounds included benzo(a)anthracene, benzo(a)pyrene, benzo(a)fluoranthene, benzo(k)fluoranthene, chrysene, and indeno(1,2,3-cd)pyrene. Benzo(b)fluoranthene was the PAH detected at the highest concentration, present at 0.09 µg/L (AQWSGV of 0.002 µg/L).

Metals: All of the monitoring wells sampled had detections of various total metals and dissolved metals exceeding their respective AWQSGVs. These metals included manganese, sodium, iron, and magnesium.

Pesticides: No pesticides were detected at concentrations exceeding AWQSGVs.

PCBs: No PCBs were detected at concentrations exceeding AWQSGVs.

2.3.3 Soil Vapor Quality

Six soil vapor samples were collected and analyzed for VOCs. Soil vapor sampling results are summarized below, and a summary of detected compounds is shown on Figure 7.

Petroleum-related VOCs and CVOCs were detected in soil vapor samples throughout the Site based on the results provided in the 2020 GBTS RIR. Petroleum-related VOCs including benzene, toluene, ethylbenzene, and xylenes, were detected within all samples; however, there are no standards or guidance values for these compounds set by NYSDEC or New York State Department of Health (NYSDOH).

The NYSDOH Final Guidance for Evaluating Soil Vapor Intrusion in the State of New York, October 2006, and Revised 2017 guidance (NYSDOH Guidance) provides three matrices with guidance values for sub-slab and indoor air comparison for eight CVOCs. The concentrations considered in the matrices are intended for sub-slab vapor beneath an existing building and indoor air within the building, and therefore a direct comparison cannot be made to the data collected during this investigation. Although Roux does not have the ability to collect sub-slab or indoor air samples at this time because the future buildings at the Site have not been constructed, the matrices can still be used as an evaluation for the presence of these compounds in soil vapor. The concentrations of the CVOC detections were between monitor and mitigate action levels, as such monitoring or mitigation may be warranted after considering future Site-specific conditions including potential vapor infiltration into future buildings.

Matrix A Compounds: carbon tetrachloride, cis-1,2-dichloroethene, 1,1-dichloroethene, TCE

- Carbon tetrachloride and 1,1-dichloroethene were not detected in soil vapor.
- Maximum concentration of cis-1,2-dichloroethene was detected at SV-01 at 1.4 µg/m3.
- Maximum concentration of TCE was detected at SV-01 at 18 µg/m3.

Matrix B Compounds: PCE, 1,1,1-trichloroethane, methylene chloride

- Maximum concentration of PCE was detected at SV-01 at 260 µg/m3.

- Maximum concentration of 1,1,1-Trichloroethane was detected at SV-03 at 3.4 µg/m3.
- Methylene chloride was not detected in soil vapor.

Matrix C Compound: vinyl chloride

- Vinyl chloride was not detected in soil vapor.

2.3.4 Underground Storage Tanks

According to the 2019 EBC Phase I ESA, regulatory agency record reviews, the Site (identified as Throop Avenue and Bartlett Street) was listed in the Petroleum Bulk Storage (PBS) UST database as having four 550-gallon steel USTs containing an unspecified product which were removed in 1994. Available records did not indicate the exact address(es) or lot(s) from which the USTs were removed. A copy of the tank closure report was not provided to EBC. There were no spill incidents listed in connection with the USTs and the Site was not identified in the NYSDEC Leaking Underground Storage Tank (LTANKS) database. Therefore, the Phase I ESA considered the four removed USTs to be a HREC that did not warrant further investigation.

2.3.5 NYSDEC Spill Incidents

According to the Phase I ESA, the Site was listed in the NY SPILLS database in connection with two minor closed spill incidents. The first closed incident (Spill No. 9212706) occurred on January 31, 1993, related to the discovery of petroleum impacted soil during the collection of soil samples. No additional information was provided regarding the exact address or Lot on which the spill occurred, and the spill was closed on June 28, 1999. The second closed incident (Spill No. 0411773) occurred on February 3, 2005, related to the discovery of a buried 20-gallon drum containing an unknown oil identified on-Site at the address 90-92 Gerry Street (Lot 25) during a Phase II investigation. The drum was removed along with 35 tons of impacted soils, a post-excavation soil sample did not exhibit evidence of contamination, and the spill was closed on June 26, 2008. Given the nature of these releases and their closed status, EBC considered the closed NYSDEC spill incidents to be a HREC that did not warrant further investigation.

During the 2020 GBTS remedial investigation, petroleum odors, staining, and elevated PID readings were observed at boring SB-06 (peak value 89.4 ppm at 8 ft bls) and at SB-09 (peak value 60.2 ppm at 8 ft bls) from approximately 7-11 ft bls. An additional sample was collected from SB-06 at 8-10 ft bls based on these observations. Slight odors and elevated PID readings (peak value 10.8 ppm) were observed at SB-08 from 3-6 ft bls. Low PID readings (ranging from 0.3 ppm at SB-04 to 3.8 ppm at SB-05) were observed at SB-01, SB-03, SB-04, SB-05 and SB-07, with slight petroleum odors and staining at SB-04 at approximately 3 ft bls. No other positive PID readings or field evidence of contamination was noted at any other soil boring location. Based on these observations, which are consistent with a historical petroleum release at the northeastern corner of the Site, NYSDEC Spill No. 2001570 was opened on June 3, 2020.

2.3.6 NYC OER E-Designations

According to the EBC Phase I ESA, the Site is identified as having E-Designations for Air Quality (E-238) on lots 27 through 31, 33, 35, and 36, which were assigned during the Broadway Triangle Rezoning completed by the City in December 2009 (CEQR 09HPD019K). In addition, Lot 25 is identified as having an E-Designation for Hazardous Materials. The Hazardous Materials designation indicates that there is a potential for soil and groundwater beneath the Site to be impacted by historic operations associated with the Site or adjacent properties. The Air Quality E-Designation requires that any new residential and/or commercial development utilize natural gas for the heating, ventilation and air conditioning and that stacks must be 55 feet from the western lot line or utilize No. 2 fuel oil with stacks a minimum 70 feet from the western lot line to avoid any potential significant adverse air quality impacts.

3. RI Work Plan Objectives, Scope, and Rationale

Roux, on behalf of the Applicant, has developed a RI scope of work (presented in this RIWP) that is intended to satisfy NYSDEC BCP requirements to delineate the nature and extent of contamination and allow for effective evaluation of multiple BCP cleanup track alternatives. Data collected during the RI will determine the basis for future Remedial Actions for the Site.

Standards, Criteria, and Guidance (SCGs) for soil at BCP Sites are the numerical soil cleanup objectives (SCOs) presented in 6 NYCRR Part 375. The SCOs are categorized into unrestricted use criteria and restricted use (Residential, Restricted Residential, Commercial, or Industrial) criteria, as well as criteria for protection of groundwater (PGW) and ecological resources. The applicability of each category of SCOs is determined based upon the current and reasonably anticipated future use of the Site, as well as cleanup tracks being evaluated. The anticipated redevelopment for the Site is a mixed-use building with multifamily affordable housing, so the applicable standards are UUSCOs if a Track 1 remedy is contemplated, or RRSCOs if Track 2 or Track 4 remedies are contemplated.

Although the groundwater beneath the Site is not used as a drinking water source, the NYSDEC AWQSGVs – TOGS 1.1.1. will be considered when evaluating groundwater data.

The NYSDOH Guidance employs three matrices to determine whether monitoring or mitigation of soil vapor levels are recommended, based on concentrations present in sub-slab and indoor air samples. Although no indoor air samples will be collected during the RI based on the absence of existing structures at the Site, potential soil vapor impacts identified in accordance with the NYSDOH Guidance will be considered when evaluating soil vapor data.

3.1 Objectives

The following areas of concern (AOCs) were identified within the Site limits based on historic Site documents and investigations:

- Presence of soil contamination due to the petroleum release (Spill No. 2001570 reported June 3, 2020) at the northeastern corner of the Site (Lot 27);
- Presence of soil contamination due to the historical automotive repair facility (65 Bartlett Street; Lot 35); and
- Presence of PAHs, metals, pesticides, and historical debris present throughout Site soils.

Based on the existing data for the Site and known data gaps, the following objectives have been identified for the RIWP:

- Further delineate the nature and extent of potential impacts to soil from the AOCs described above;
- Delineate the nature and extent of impacts to groundwater; and
- Delineate the nature and extent of impacts to soil vapor.

The RI will evaluate soil, groundwater, and soil vapor impacts on-Site and at the property boundaries to provide the basis for remedial action selection and to determine the potential for off-Site impacts. Environmental data collected during the RI will be used to qualitatively assess the potential exposure of receptors to Site contaminants and develop the information necessary to support the development of a RAWP.

3.2 RI Scope

The scope of the RI will include the collection of sufficient Site characterization data so that, together with the historical data, the entire Site will be sufficiently characterized to support the development of the Site-wide RAWP. To accomplish this, the scope of work for the RI will include the following:

- The performance of Site reconnaissance to confirm proposed sampling locations;
- The performance of a geophysical survey using ground penetrating radar (GPR) and line locating techniques to identify any underground utilities or anomalies and clear proposed boring locations;
- The advancement of 11 soil borings;
- The installation of five permanent groundwater monitoring wells and five temporary soil vapor points;
- The collection of 22 soil samples, five groundwater samples, and five soil vapor samples sufficient to define the nature and extent of impacted media and current Site conditions;
- The collection of groundwater level measurements and land survey data as needed for developing a groundwater elevation contour map; and
- The performance of a qualitative Exposure Assessment (EA) to identify exposure pathways and evaluate contaminant fate and transport.

The overall scope of each component of the RI is discussed in the following subsections. Detailed field sampling procedures, including tables indicating sample location rationale, and summarizing the analytical methods and holding times for each analysis and media type, are provided in the Quality Assurance Project Plan/Field Sampling Plan (QAPP/FSP) included as Appendix B. The proposed sampling locations are shown on Figure 8 of this RIWP and additional information, including intervals to be sampled and sample rationale, is provided in the sections below. All investigation efforts associated with collecting the proposed samples on Lots 29 and 33 during the RI are outside the purview of the BCP at this time since these lots are not currently eligible for enrollment in the BCP.

3.2.1 Site Reconnaissance and Geophysical Survey

Roux has performed a preliminary Site reconnaissance and has identified potential AOCs, described in Section 3.1., which will be targeted with soil, groundwater, and soil vapor samples during the RI. Roux will perform an additional Site reconnaissance prior to the implementation of the subsurface investigation. An inspection of the existing Site conditions will be conducted to determine final sampling locations based on actual field conditions. The current layout of the proposed sampling locations, as shown in Figure 8, was developed to provide coverage across the entire Site footprint.

Concurrent with the Site reconnaissance, a geophysical survey will be conducted over the entire Site to identify any subsurface utilities, conduits, or obstructions. Based on the Site reconnaissance and geophysical survey results, the layout of proposed sampling locations may change. If proposed sampling locations are adjusted more than 10 ft from their original location on Figure 8, Roux will notify NYSDEC prior to installation or sampling.

3.2.2 Soil Investigation

During Roux's December 2020 BCP eligibility soil investigation, soil data was collected throughout the Site in a manner consistent with DER-10. It is our opinion that this data accurately characterize soil conditions at discrete intervals at the Site. The additional soil investigation proposed as part of this RI will supplement that existing data. In order to incorporate the prior soil data into Roux's Remedial Investigation Report/Remedial

Action Work Plan (RIR/RAWP), a DUSR will be performed to validate that all Roux soil eligibility sampling and RI data meets applicable data quality objectives. The 2020 GBTS RIR data was used at a preliminary screening level to select the locations of the eligibility investigation samples and proposed RI samples; however, since NYSDEC Analytical Services Protocols (ASP) Category B reports were not published in the GBTS RIR, this data will not be included in the DUSR submitted as part of the RIR/RAWP prepared for the Site.

To collect additional data to vertically delineate contamination at the Site, soil samples will be collected from the 11 soil borings that will be advanced at the locations shown in Figure 8 as part of the RI to supplement the seven (not including QA/QC) soil samples collected from seven soil borings during Roux's 2020 eligibility sampling event. Boreholes will be pre-cleared to five ft bls using non-intrusive methods, such as vacuum clearance and hand tools to verify the absence of utilities and/or other subsurface features (i.e., obstructions and/or refusal). Should a utility or other feature be observed during pre-clearance activities, the sampling location will be relocated to no more than 10 ft away from the original proposed sample location. If a boring is proposed to be moved more than 10 ft from the location shown on Figure 8, the NYSDEC project manager will be consulted prior to installing the boring at the new location.

Following utility clearance and the geophysical survey, the soil borings will be advanced using a Geoprobe direct push drill rig. Soil will be collected continuously from land surface to approximately 15 ft bls for standard soil borings (to bridge the water table) and to approximately 20 ft bls for monitoring well installation borings (to allow for optimal well depth), as indicated in the QAPP/FSP (Appendix B). During advancement of borings, the soil will be inspected for evidence of contamination (visual and olfactory) and field screened continuously for organic vapors using a PID with a 10.6 eV lamp. Soil lithology will be recorded according to the Unified Soils Classification System (USCS). The sample intervals selected for laboratory analysis will vary at each boring location as indicated in the QAPP/FSP to allow for the delineation of soil impacts beginning immediately beneath the overlying fill layer and extending into the water table. It is anticipated that at least two soil samples will be collected from each soil boring and analyzed using a phased approach, as supported by the sampling rationale provided below and described in more detail in the QAPP/FSP. One additional soil sample may be collected from each borehole if further odor/visual evidence of contamination or elevated PID measurements are noted.

Analysis of soil samples will occur in a phased approach. Initially, the shallower of the two soil samples collected from beneath the fill layer at each borehole will be analyzed for the parameters listed below. If the result of that analysis for each borehole contains exceedances of UUSCOs, the deeper sample will also be analyzed to provide additional vertical delineation. Soil samples will be analyzed for the TCL/Part 375 plus 30/ TAL (TCL + 30/TAL) list of parameters including:

- TCL/Part 375 VOC + 10 Tentatively identified compounds (TICs);
- TCL/Part 375 Base neutral acids (BNA)/SVOCs + 20 TICs;
- TCL/Part 375 Pesticides;
- TCL/Part 375 Herbicides;
- TCL/Part 375 PCBs;
- TAL/Part 375 Metals (including trivalent chromium, hexavalent chromium, mercury); and
- Total Cyanide.

Additionally, as required by NYSDEC, soil samples will be analyzed for the emerging contaminants (ECs) 1,4-Dioxane and PFAS, which include the 21 compounds listed in accordance with the Sampling, Analysis, and Assessment of PFAS under NYSDEC's Part 375 Remedial Programs guidance document (NYSDEC January 2021 PFAS Guidance).

Two additional blind duplicate soil sample, two matrix spike (MS) soil samples, two matrix spike duplicate (MSD) soil samples, field blanks, and trip blanks will be collected for QA/QC purposes. Additional details regarding sampling methods are provided in the QAPP/FSP (Appendix B).

Following sample collection, selected boreholes will be converted to monitoring wells or soil vapor sampling points, as discussed below. Soil cuttings will be returned to the boring to the extent possible to reduce the quantity of drummed waste. Soil generated as part of the soil investigation, if any, will be drummed, labeled, sampled, and stored on-Site pending disposal.

3.2.3 Groundwater Investigation

To characterize on-Site groundwater flow and groundwater quality, five of the 11 soil borings are proposed to be converted into permanent groundwater monitoring wells for sampling and analysis. The proposed RI monitoring well locations are shown on Figure 8.

The monitoring wells will be installed to provide a better understanding of on-Site groundwater flow and to fill groundwater quality data gaps from prior groundwater investigations. Monitoring wells will be installed using a Geoprobe with hollow stem augers and constructed with a minimum of 10 ft of two-inch diameter, 0.02-inch slotted Schedule 40 polyvinyl chloride (PVC) screen set to straddle the water table. At least 7 feet of screen will extend into the water table and at least 3 feet of screen will extend above to account for seasonal fluctuations in groundwater elevation. The QAPP/FSP in Appendix B contains further monitoring well design and construction details.

The new monitoring wells will be developed following installation to establish good hydraulic connection between the well and surrounding formation. No sooner than one week following their installation, a comprehensive water-level gauging event will occur prior to groundwater sampling to characterize groundwater flow on-Site. Groundwater in each well will be measured using an electronic oil-water interface probe and a groundwater contour map will be developed using the gauging and survey data (as described in Section 3.2.6). Following purging, groundwater samples will be collected from the newly installed monitoring wells using a battery-operated peristaltic pump capable of achieving a flow rate of 250 milliliters per minute or less in accordance with USEPA procedures for low-flow sampling. Detailed procedures regarding well development and groundwater sampling, including those compliant with collecting and analyzing for PFAS, are provided in the QAPP/FSP Section 5.2 (Appendix B).

Five groundwater samples will be collected for laboratory analysis (not including QA/QC samples). All groundwater samples will be analyzed for the TCL + 30/TAL list of parameters including:

- TCL/Part 375 VOC + 10 TICs;
- TCL/Part 375 BNA/SVOCs + 20 TICs;
- TCL/Part 375 Pesticides;
- TCL/Part 375 Herbicides;
- TCL/Part 375 PCBs;

- TAL/Part 375 Metals (including trivalent chromium, hexavalent chromium, mercury); and
- Total Cyanide.

Groundwater samples will be filtered by the laboratory for metals and both filtered and unfiltered results will be reported.

Additionally, as required by NYSDEC, groundwater samples will also be analyzed for the ECs 1,4-Dioxane and PFAS, which include the 21 compounds listed in the NYSDEC January 2021 Guidance.

Additionally, one blind duplicate groundwater sample, one MS groundwater sample, one MSD groundwater sample, field blanks, and trip blanks will be collected for QA/QC purposes. Additional details regarding sampling methods are provided in the QAPP/FSP (Appendix B). Water generated as part of the well development and purging effort prior to sample collection will be drummed, labeled, sampled, and stored on-Site pending disposal.

3.2.4 Soil Vapor Investigation

Five temporary soil vapor sample locations are proposed to be installed as part of the RI. Two of the soil borings will be converted to soil vapor points and new boreholes will be advanced to install the remaining three vapor points. The proposed RI soil vapor sample locations are shown on Figure 8.

The soil vapor monitoring points will be installed at approximately two feet above the observed water table based on field observations while advancing soil borings. At each location, a six-inch long, stainless steel sample screen attached to Teflon-lined polyethylene sample tubing will be installed two feet above the water table and #2 Morie sand will be added to six-inches above the top of the screen. A one-foot thick layer of bentonite will be added to the top of the sand and left to hydrate. After allowing the bentonite seal to hydrate, the remainder of the boring annulus will be filled with a cement/bentonite grout slurry. Additional details regarding soil vapor point construction is provided in the QAPP/FSP (Appendix B).

Five soil vapor samples (not including QA/QC samples) will be collected for laboratory analysis of VOCs using United States Environmental Protection Agency (USEPA) Method TO-15. One blind duplicate soil vapor sample will also be collected for QA/QC purposes. All soil vapor samples will be collected using pre-cleaned 6-liter summa canisters with flow regulators that have been batch certified and calibrated to collect samples over a two-hour period at a flow rate of 200 milliliters per minute. A tracer gas will be employed during the collection of soil vapor samples to ensure the integrity of the vapor probe seal and to verify that the vapor samples do not become inadvertently diluted with ambient air. Field parameters will be recorded on vapor sampling data forms and included in the RI Report. Additional details regarding sampling methods are provided in the QAPP/FSP (Appendix B).

3.2.5 Investigation Laboratory Analysis

All samples will be analyzed at a NYSDOH Environmental Laboratory Approval Program-certified (ELAP) laboratory. Additional details regarding laboratory analyses are included in the QAPP/FSP (Appendix B). All analytical data for the RI will be received with standard 5-day turn-around-time.

All RI data will be produced in accordance with NYSDEC ASP Category B deliverables and will be reviewed and validated by a third-party data validator, who will prepare a Data Usability Summary Report (DUSR)

before being incorporated into the final RIR for the Site. All data will be submitted to NYSDEC in electronic format, in accordance with DER-10, Section 1.15.

3.2.6 Surveying Assessment

All newly installed monitoring wells will be surveyed by a New York Licensed Surveyor to obtain horizontal and vertical coordinates and grade elevations. Measuring point elevations from newly installed monitoring wells will also be surveyed to enable groundwater flow contouring. Horizontal coordinates will be based upon New York State Plane Coordinate System, Long Island Zone, North American Datum of 1983 (NAD 83) in US Survey Feet. Vertical elevations will be measured for top-of-casing (measuring point) and grade elevations referenced to North American Vertical Datum of 1988 (NAVD 88).

3.2.7 Investigation Derived Waste

Purge water and visibly impacted drill cuttings generated as part of the investigation will be drummed, labeled, sampled, and stored on-Site pending laboratory results. Disposal will be coordinated following the receipt of laboratory results. Investigation derived waste (IDW) will not be stored on-Site for longer than 90 days.

3.2.8 Community Air Monitoring Plan

Roux will implement a Community Air Monitoring Plan (CAMP) during any intrusive subsurface activities to conduct monitoring and protection for potential off-Site receptors. The CAMP scope of work will include the use of one downwind air monitoring station and one upwind air monitoring station each equipped with one PID and one particulate meter. Upwind concentrations will be measured at the start of each workday and periodically throughout the day to establish background concentrations. Daily reporting of any exceedances will be provided to the NYSDEC and NYSDOH. The results of the CAMP data will be provided to the NYSDEC and NYSDOH on a weekly basis. CAMP data results will be provided in the final RIR along with locations of perimeter monitoring stations, monitoring equipment, procedures, and contaminant action levels. Details regarding CAMP procedures are included in Appendix C.

3.2.9 Qualitative Exposure Assessment

A qualitative human health EA will be performed following the collection of all RI data. The EA will be performed in accordance with Section 3.3(c)4 of DER-10 and the NYSDOH guidance for performing a qualitative EA (DER-10; Appendix 3B). The results of the qualitative EA will be provided in the RIR.

According to Section 3.10 of DER-10, and the Fish and Wildlife Resources Impact Analysis Decision Key in DER-10 Appendix 3C, a Fish and Wildlife EA is not needed for this Site.

4. Quality Assurance/ Quality Control (QA/QC) Protocols

The goal of the QA/QC aspect of the RI is to ensure that suitable and verifiable data results from sampling and analysis are obtained. To accomplish this, a QAPP/FSP has been prepared and is provided as Appendix B.

5. Health and Safety

A Community Air Monitoring Plan (CAMP) has been prepared for the Site and is provided within Appendix C. A Site-specific Health and Safety Plan (HASP) has been prepared for the Site and is provided in Appendix D on the flash drive enclosed with the bound copy of this RIWP.

6. Reporting and Schedule

Roux and the Volunteer will commence implementation of this RIWP following the receipt of NYSDEC's written approval. Roux will notify NYSDEC no less than seven days in advance of implementation of the RIWP, unless NYSDEC agrees to a shorter period in writing. Roux will also provide NYSDEC notice as to any change in the approved project schedule. The following will be provided to the NYSDEC during the course of the RI work.

Progress Reports

Progress report submittals to be provided to the NYSDEC and NYSDOH will include the following:

- Daily reports during implementation of the RIWP;
- Weekly summary tables of the CAMP monitoring data;
- NYSDEC and NYSDOH will be notified immediately (within 24 hours) of any CAMP exceedances and corrective actions taken;
- Periodic reports, no less than one per month as required by the Brownfield Cleanup Agreement (BCA), will be submitted during RI activities;
- Discovery of any previously unknown contaminated media during RI activities will be promptly communicated to NYSDEC's project manager; and
- A Site map will be provided to identify locations discussed in progress reports provided to NYSDEC.

Remedial Investigation Report

Following the completion of the RI, a RIR will be prepared to summarize the results and findings of the RI. The RIR will likely be combined with the RAWP into a single RIR/RAWP due to project construction timeline constraints.

The RIR/RAWP will include all data developed during the RI and will meet the technical requirements of DER-10.

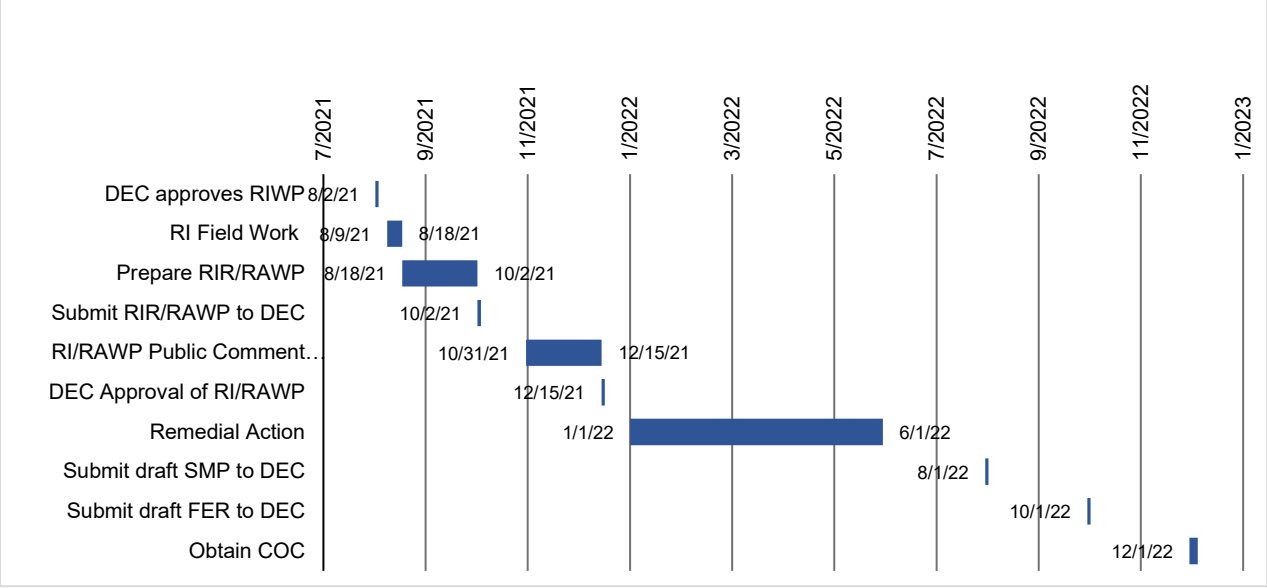

FIGURES

1. Site Location Map
2. Tax Map
3. Existing Conditions
4. Adjacent Property Owners and Surrounding Land Use
5. Soil Sample Locations and Exceedances
6. Groundwater Sample Locations and Exceedances
7. Soil Vapor Sample Locations and Detections
8. Proposed Remedial Investigation Sample Locations

SITE
Greenpoint
Williamsburg
Linden Hill
Bedford Stuyvesant
Adelphi
Brooklyn Navy Yards Industrial Park
Pratt Institute
McCarren Park
Marsha P Johnson State Park
Sternberg Park
Marcy Playground
Herbert Von King Park
Jesse Owens Playground
Maria Hernandez Park
Fulton Park
Cooper Park
Green Central Knoll
Woodhull Med & Mental Hlth Center
P.S. 368
P.S. 376
M.S. 582
Greenpoint Ave
Flushing Ave
Myrtle Ave
Willoughby Ave
Broadway
Metropolitan Ave
Grand St
Bedford Ave
Lee Ave
Nostrand Ave
Bushwick Ave
Marcy Ave
Kent Ave
Wythe Ave
Driggs Ave
Graham Ave
Humboldt St
Manhattan Ave
Union Ave
Lorimer St
Havemeyer St
Roebling St
Berry St
Franklin Ave
Classon Ave
Washington Ave
Clinton Ave
Vanderbilt Ave
Carlton Ave
Underhill Ave
Grand Ave
Nassau Ave
Meeker Ave
Morgan Ave
Knickerbocker Ave
Wyckoff Ave
Flushing Ave
Johnson Ave
Harrison Pl
Thames St
Grattan St
Varet St
Cook St
Seigel St
McKibbin St
Moore St
Leonard St
Boerum St
Montrose Ave
Meserole St
Ten Eyck St
Maujer St
Powers St
Ainslie St
Devoe St
Conselyea St
Skillman Ave
Withers St
Frost St
Richardson St
Bayard St
Lorimer St
Manhattan Ave
Herbert St
Engert Ave
Driggs Ave
Anthony St
Lombardy St
Beadel St
Division Pl
Vandervoort Ave
Morgan Ave
Maspeth Ave
Maspeth Creek
English Kills
Rewe St
Grand St
Onderdonk Ave
Sharon St
Metropolitan Ave
Olive St
Waterbury St
Meadow St
Stagg St
Randolph St
Varick Ave
Scott Ave
Gardner Ave
Stewart Ave
Meserole St
Long Island
Cypress Ave
St Nicholas Ave
Willoughby Ave
Sumpter St
Hart St
Stanwix St
Beaver St
Arion Pl
De Kalb Ave
Wilson Ave
Central Ave
Himrod St
Harman St
Greene Ave
Bleecker St
Evergreen Ave
Cedar St
Noll St
George St
Melrose St
Bogart St
White St
Jefferson St
Troutman St
Starr St
Knickerbocker Ave
Ingraham St
Harrison Pl
Flushing Ave
Cypress Ave
Kosciuszko St
Lafayette Ave
Van Buren St
Greene Ave
Lexington Ave
Quincy St
Gates Ave
Monroe St
Madison St
Jefferson Ave
Halsey St
Macon St
Macdonough St
Decatur St
Bainbridge St
Chauncey St
Fulton St
Putnam Ave
Hancock St
Clifton Pl
Willoughby Ave
Hall St
Sandford St
Skillman St
Waverly Ave
St James Pl
Cambridge Pl
Downing St
Irving Pl
Franklin Ave
Clavel Pl
Lefferts Pl
Atlantic Ave
Bergen St
Fulton St
Malcolm X Blvd
Dr Sandy F Ray Blvd
Marcus Garvey Blvd
Stuyvesant Ave
Tompkins Ave
Throop Ave
Ralph Ave
Howard Ave
Patchen Ave
Sarato
Macon St
Pulaski St
De Kalb Ave
Park Ave
Ellery St
Hopkins St
Flushing Ave
Wallabout St
Wallabout Rd
Assembly Rd
Market St
Paulding St
Flushing Ave
Park Ave
Myrtle Ave
Willoughby Ave
Hart St
Vernon Ave
Pulaski St
De Kalb Ave
Lafayette Ave
Greene

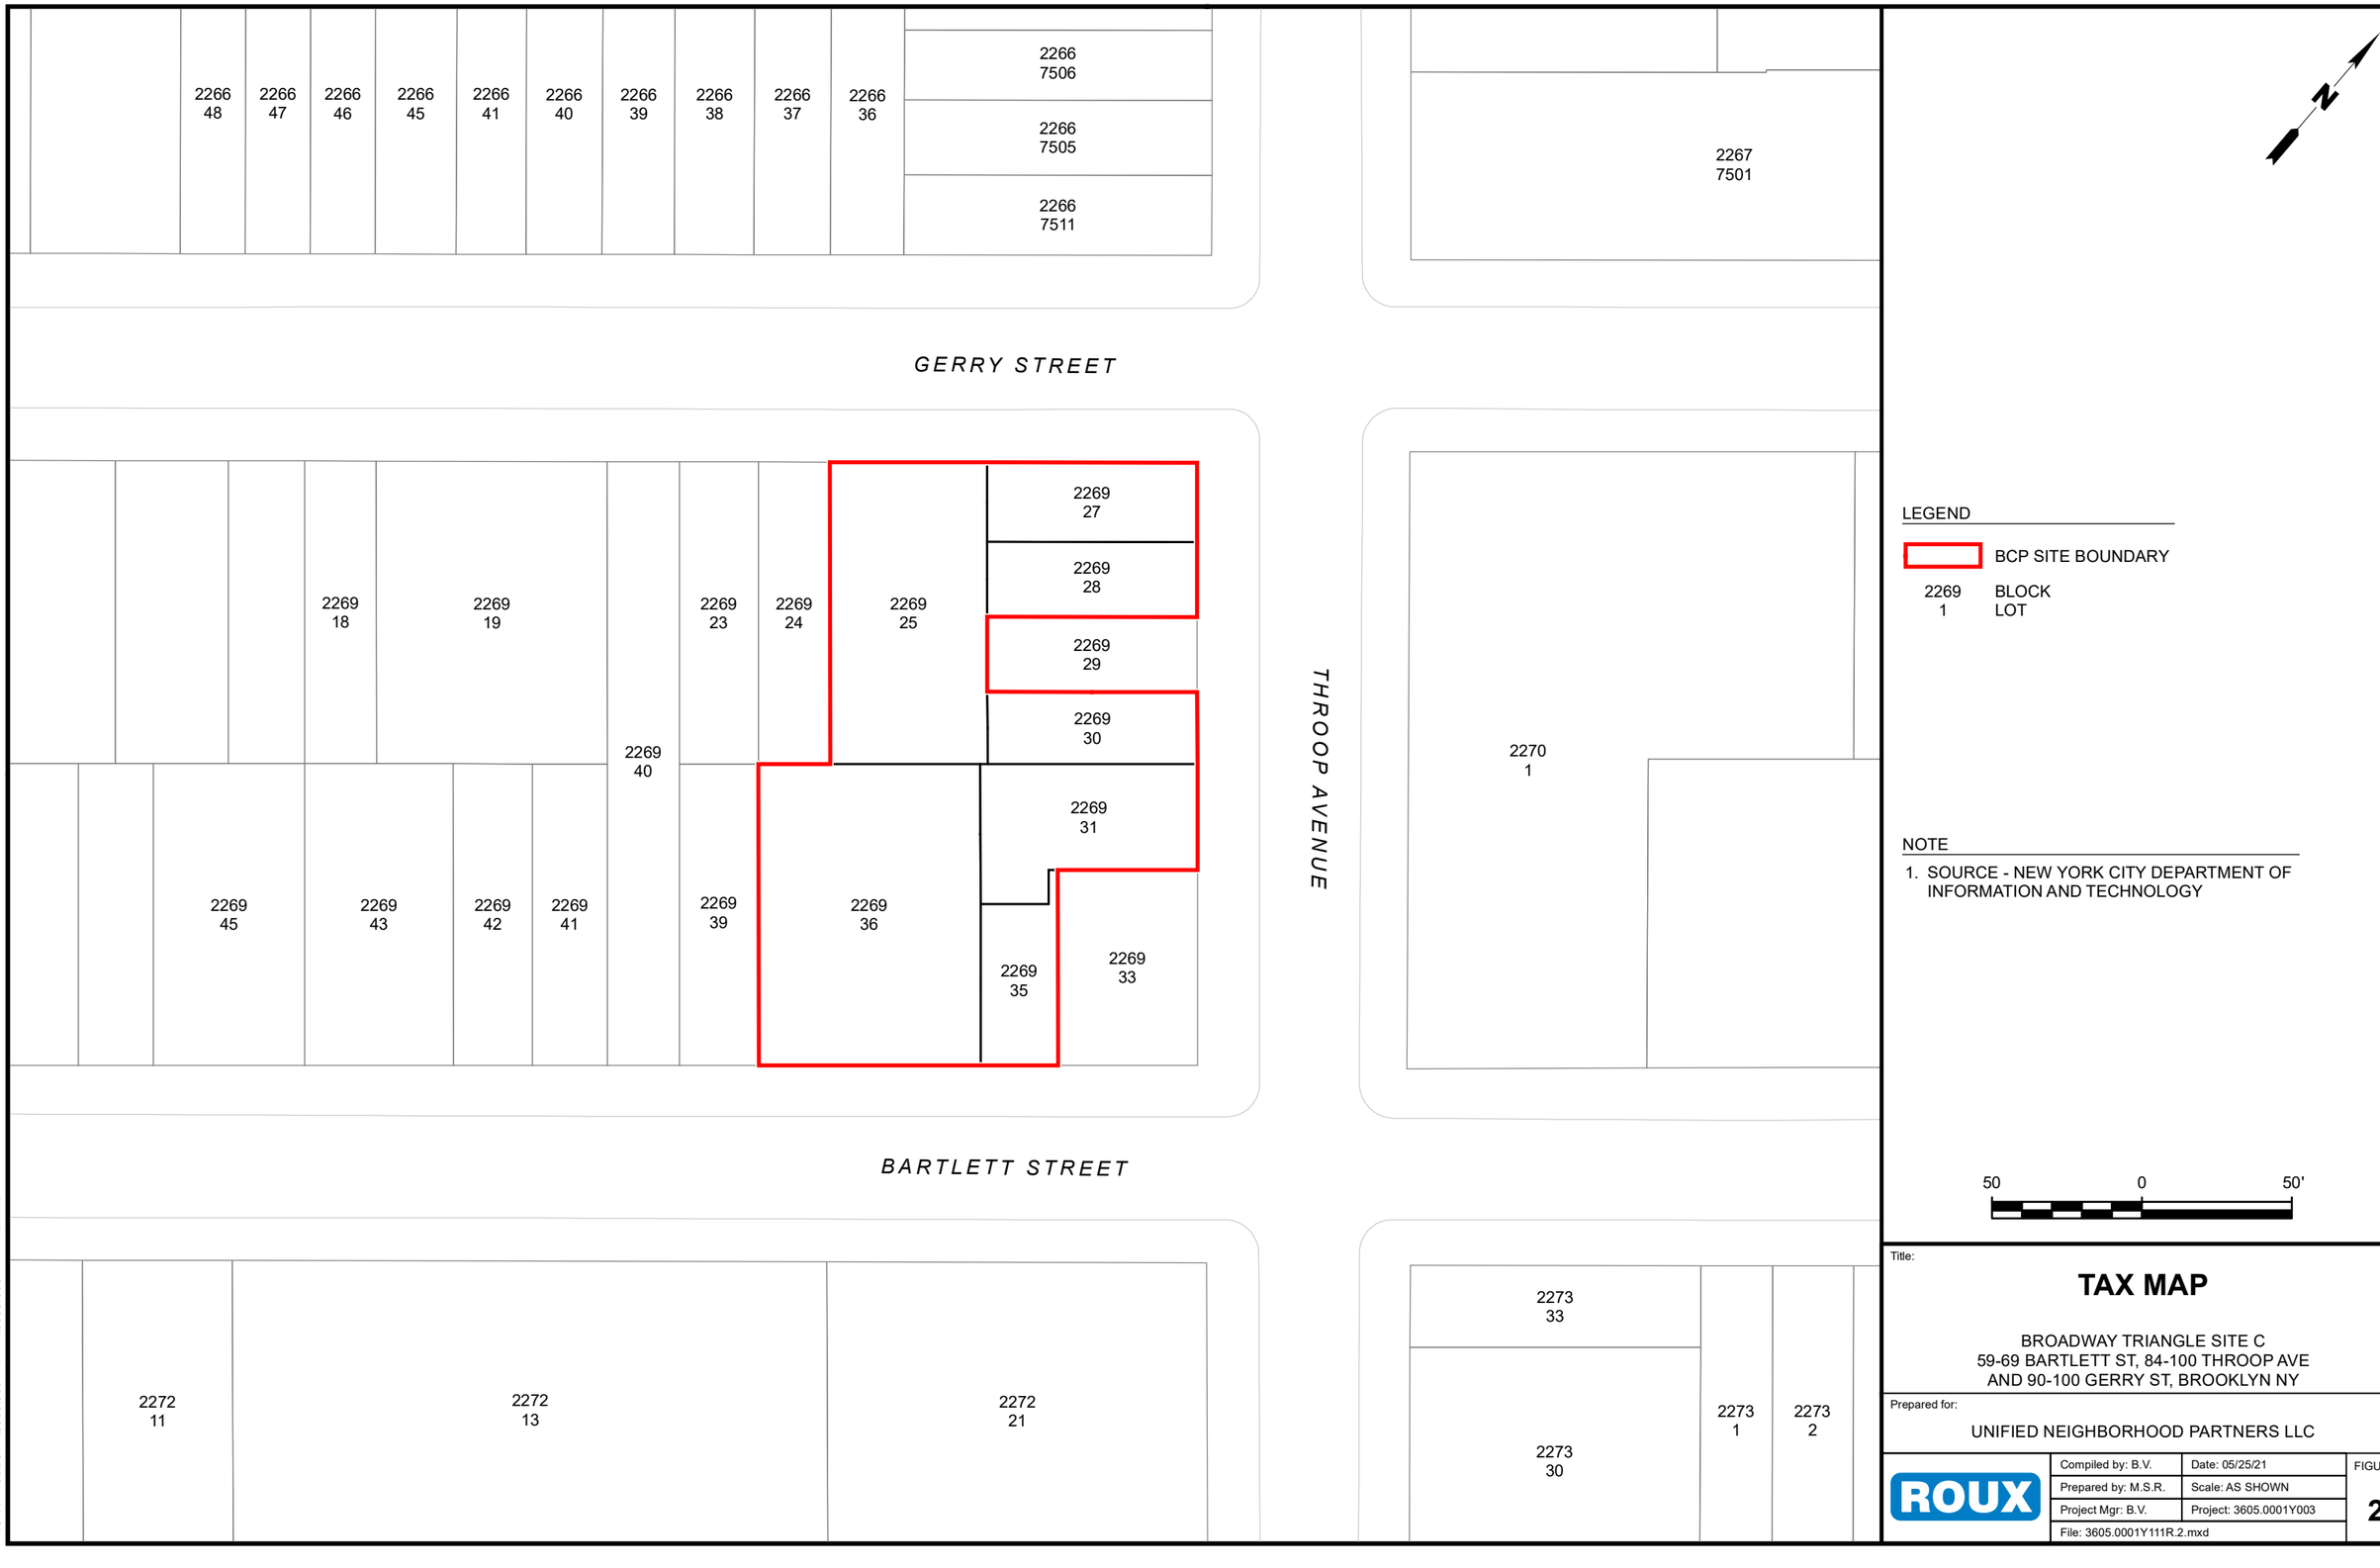

V:\GIS\PROJECTS\3605\0001Y\111R\3605.0001Y111R.2.MXD

Title:

TAX MAP

BROADWAY TRIANGLE SITE C
59-69 BARTLETT ST, 84-100 THROOP AVE
AND 90-100 GERRY ST, BROOKLYN NY

Prepared for:

UNIFIED NEIGHBORHOOD PARTNERS LLC

ROUX

Compiled by: B.V.	Date: 05/25/21	FIGURE
Prepared by: M.S.R.	Scale: AS SHOWN	2
Project Mgr: B.V.	Project: 3605.0001Y003	
File: 3605.0001Y111R.2.mxd		

N

LEGEND

BCP SITE BOUNDARY

50 0 50'

Title:

EXISTING CONDITIONS

BROADWAY TRIANGLE SITE C
59-69 BARTLETT ST, 84-100 THROOP AVE
AND 90-100 GERRY ST, BROOKLYN NY

Prepared for:

UNIFIED NEIGHBORHOOD PARTNERS LLC

ROUX

Compiled by: B.V.	Date: 07/19/21	FIGURE
Prepared by: M.S.R.	Scale: AS SHOWN	3
Project Mgr: B.V.	Project: 3605.0001Y003	
File: 3605.0001Y111R.3.mxd		

V:\GIS\PROJECTS\3605\0001Y\111R\3605.0001Y111R.3.MXD

GGH HOLDINGS LLC
GGH HOLDINGS LLC
GGH HOLDINGS LLC
LEIBY ZIPORA
GREENFIELD, ISAAC
NYC HOUSING PRESERVATION AND DEVELOPMENT
UNAVAILABLE OWNER
UNAVAILABLE OWNER
UNAVAILABLE OWNER

UNAVAILABLE OWNER

GERRY STREET

NYC HOUSING PRESERVATION AND DEVELOPMENT
78 GERRY ST. REALTY INC.
GETZEL/CUST FOR
NYC HOUSING PRESERVATION AND DEVELOPMENT
ELLENBOGEN JANICE

JACOB BARTLETT LLC
51 BARTLETT LLC
NYC HOUSING PRESERVATION AND DEVELOPMENT
GELB, SARA

THROOP AVENUE

120 GERRY STREET HOUSING DEVELOPMENT FUN D CORPORAT

BARTLETT STREET

NYC DEPARTMENT OF PARKS AND RECREATION
BETH RACHEL SCHOOL FO

89 THROOP LLC

N

LEGEND

- BCP SITE BOUNDARY
- ONE & TWO FAMILY BUILDINGS
- MULTI-FAMILY WALK-UP BUILDINGS
- MULTI-FAMILY ELEVATOR BUILDINGS
- MIXED RESIDENTIAL & COMMERCIAL BUILDINGS
- INDUSTRIAL & MANUFACTURING
- TRANSPORTATION & UTILITY
- PUBLIC FACILITIES AND INSTITUTIONS
- OPEN SPACE & OUTDOOR RECREATION
- PARKING FACILITIES
- VACANT LAND
- UNKNOWN

NOTE

1. SOURCE - NEW YORK CITY DEPARTMENT OF INFORMATION AND TECHNOLOGY

50 0 50'

Title:

ADJACENT PROPERTY OWNERS & SURROUNDING LAND USE

BROADWAY TRIANGLE SITE C
59-69 BARTLETT ST, 84-100 THROOP AVE
AND 90-100 GERRY ST, BROOKLYN NY

Prepared for:

UNIFIED NEIGHBORHOOD PARTNERS LLC

ROUX

Compiled by: B.V.	Date: 07/19/21
Prepared by: M.S.R.	Scale: AS SHOWN
Project Mgr: B.V.	Project: 3605.0001Y003
File: 3605.0001Y111R.4.mxd	

FIGURE 4

V:\GIS\PROJECTS\3605\0001Y\111R\3605.0001Y111R.4.MXD

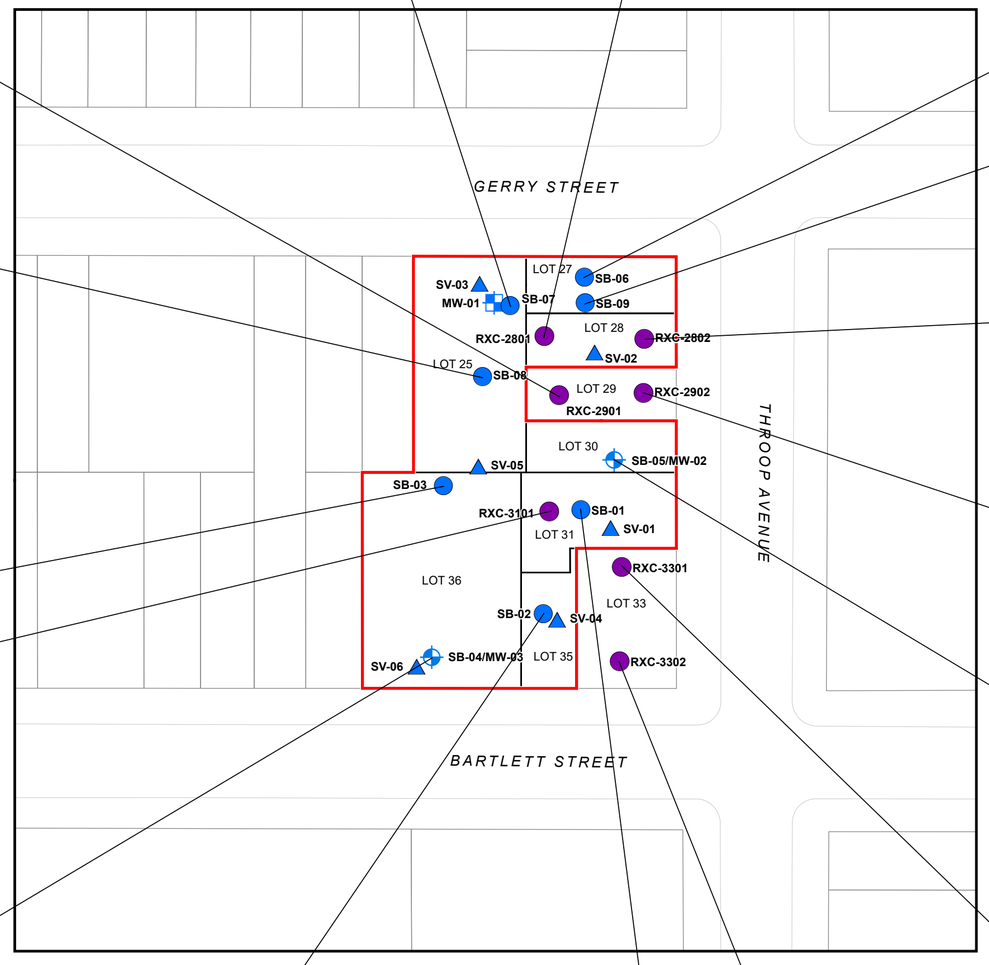

RXC-2901	12/23/2020
Depth (ft bls)	0 - 2
Metals	
Copper	**85.4**
Lead	**132**

SB-07	4/6/2020	4/6/2020
Depth (ft bls)	0 - 2	5 - 7
Metals		
Barium	NE	**1530**
Chromium	NE	**36.3**
Copper	**68.4**	**68.1**
Lead	**163**	**2050**
Mercury	**0.248**	**4.92**
Zinc	**120**	**301**

RXC-2801	12/23/2020
Depth (ft bls)	0 - 2
Metals	
Copper	**61.2**
Lead	**400**
Mercury	**0.39**
Zinc	**455**

SB-06	4/6/2020	4/6/2020	4/6/2020
Depth (ft bls)	0 - 2	5 - 7	8 - 10
SVOCs			
Indeno(1,2,3-cd)pyrene	**0.779**	ND	ND
Metals			
Arsenic	**18.3**	ND	ND
Barium	**910**	NE	NE
Lead	**777**	NE	NE
Mercury	**0.529**	ND	ND
Zinc	**1070**	NE	NE
Pesticides			
4,4'-DDE	**0.0058**	ND	ND
4,4'-DDT	**0.0217**	ND	ND
Dieldrin	**0.0144**	ND	ND

SB-08	4/6/2020	4/6/2020
Depth (ft bls)	0 - 2	5 - 7
Metals		
Copper	**71.5**	NE
Lead	**441**	**281**
Mercury	**0.896**	**0.575**
Zinc	**216**	NE

SB-09	4/6/2020
Depth (ft bls)	7 - 9
Pesticides	
4,4'-DDD	**0.00532**

SB-03	4/6/2020	4/6/2020
Depth (ft bls)	0 - 2	4 - 6
SVOCs		
Benzo(a)anthracene	**3.33**	NE
Benzo(a)pyrene	**2.9**	NE
Benzo(b)fluoranthene	**2.91**	NE
Benzo(k)fluoranthene	**2.36**	NE
Chrysene	**3.01**	NE
Dibenzo(a,h)anthracene	**0.544**	ND
Indeno(1,2,3-cd)pyrene	**2.33**	NE
Metals		
Copper	**172**	**55.9**
Lead	**90.5**	**240**
Mercury	**1.27**	NE
Zinc	**183**	NE

RXC-2802	12/23/2020
Depth (ft bls)	0 - 2
Metals	
Lead	**460**
Mercury	**0.52**
Zinc	**393**

RXC-2902	12/23/2020	12/23/2020
Depth (ft bls)	0 - 2	0 - 2 FD
Metals		
Copper	**134**	**135**
Mercury	NE	**0.22**

RXC-3101	12/23/2020
Depth (ft bls)	0 - 2
SVOCs	
Benzo(A)Anthracene	**1.1**
Benzo(A)Pyrene	**1.2 T**
Benzo(B)Fluoranthene	**1.4**
Chrysene	**1.1**
Indeno(1,2,3-C,D)Pyrene	**0.65**
Metals	
Copper	**87.1**
Lead	**225**
Mercury	**1.1**
Zinc	**307**

SB-05/MW-02	4/6/2020	4/6/2020
Depth (ft bls)	0 - 2	15 - 17
SVOCs		
Indeno(1,2,3-cd)pyrene	**0.595**	ND
Metals		
Copper	**86.8**	NE
Lead	**118**	NE
Mercury	**0.208**	ND
Zinc	**124**	NE

SB-04/MW-03	4/6/2020	4/6/2020
Depth (ft bls)	0 - 2	5 - 7
SVOCs		
Benzo(a)anthracene	**4.74**	NE
Benzo(a)pyrene	**5.07**	NE
Benzo(b)fluoranthene	**5.14**	NE
Benzo(k)fluoranthene	**4.02**	NE
Chrysene	**4.66**	NE
Dibenzo(a,h)anthracene	**1.36**	ND
Indeno(1,2,3-cd)pyrene	**4.37**	NE
Metals		
Barium	**1570**	NE
Lead	**262**	NE
Mercury	**0.64**	NE
Zinc	**621**	NE
Pesticides		
4,4'-DDD	**0.012**	ND
4,4'-DDE	**0.00828**	ND
4,4'-DDT	**0.0621**	ND
Dieldrin	**0.0202**	ND

SB-02	4/6/2020	4/6/2020
Depth (ft bls)	0 - 2	5 - 7
SVOCs		
Benzo(a)anthracene	**6.44**	NE
Benzo(a)pyrene	**5.46**	NE
Benzo(b)fluoranthene	**4.83**	NE
Benzo(k)fluoranthene	**4.12**	NE
Chrysene	**6.02**	NE
Dibenzo(a,h)anthracene	**1.13**	NE
Indeno(1,2,3-cd)pyrene	**4.26**	NE
Metals		
Chromium	**30.9**	NE
Copper	**153**	NE
Lead	**489**	**158**
Mercury	**2.34**	**3.17**
Zinc	**381**	**112**
Pesticides		
4,4'-DDT	**0.0293**	ND

SB-01	4/6/2020	4/6/2020
Depth (ft bls)	0 - 2	15 - 17
Metals		
Copper	**62.1**	NE
Lead	**135**	NE
Zinc	**310**	NE
Pesticides		
4,4'-DDT	**0.00544**	ND

RXC-3302	12/23/2020
Depth (ft bls)	0 - 2
Metals	
Copper	**59**

RXC-3301	12/23/2020
Depth (ft bls)	0 - 2
Metals	
Copper	**105**
Lead	**80**
Zinc	**113**

LEGEND

- LOCATION OF ROUX SOIL BORING
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL BORING COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL BORING AND GROUNDWATER SAMPLE COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES MONITORING WELL COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL VAPOR POINT COLLECTED IN 2020
- BCP SITE BOUNDARY

Parameter	NYSDEC Part 375 UUSCOs	NYSDEC Part 375 RRSCOs
SVOCs		
Benzo(A)Anthracene	**1**	1
Benzo(A)Pyrene	**1**	1
Benzo(B)Fluoranthene	**1**	1
Benzo(K)Fluoranthene	**0.8**	3.9
Chrysene	**1**	3.9
Dibenz(A,H)Anthracene	**0.33**	0.33
Indeno(1,2,3-C,D)Pyrene	**0.5**	0.5
Metals		
Arsenic	**13**	16
Barium	**350**	400
Chromium, Total	**30**	180
Copper	**50**	270
Lead	**63**	400
Mercury	**0.18**	0.81
Zinc	**109**	10000
Pesticides		
4,4'-DDD	**0.0033**	13
4,4'-DDE	**0.0033**	8.9
4,4'-DDT	**0.0033**	7.9
Dieldrin	**0.005**	0.2

NOTES

1. ALL CONCENTRATIONS SHOWN IN MILLIGRAMS PER KILOGRAM
2. BOLD DATA INDICATES AN EXCEEDANCE OF NYSDEC PART 375 UUSCO
3. SHADED DATA INDICATES AN EXCEEDANCE OF NYSDEC PART 375 RRSCO

FD- DUPLICATE SAMPLE
FT BLS - FEET BELOW LAND SURFACE
ND - NO DETECTION
NE - NO EXCEEDANCE
NYSDEC - NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION
PCBS - POLYCHLORINATED BIPHENYLS
RRSCOS - RESTRICTED RESIDENTIAL SOIL CLEANUP OBJECTIVES
SVOCS - SEMIVOLATILE ORGANIC COMPOUNDS
UUSCOS - UNRESTRICTED USE SOIL CLEANUP OBJECTIVES
VOCS - VOLATILE ORGANIC COMPOUNDS

50 0 50'

Title:

SOIL SAMPLE LOCATIONS AND EXCEEDANCES

BROADWAY TRIANGLE SITE C
59-69 BARTLETT ST, 84-100 THROOP AVE
AND 90-100 GERRY ST, BROOKLYN NY

Prepared for:

UNIFIED NEIGHBORHOOD PARTNERS LLC

ROUX

Compiled by: B.V.	Date: 07/19/21
Prepared by: M.S.R.	Scale: AS SHOWN
Project Mgr: B.V.	Project: 3605.0001Y003
File: 3605.0001Y111R.5.mxd	

FIGURE 5

V:\GIS\PROJECTS\3605\0001Y\111R\3605.000Y111R.5.MXD

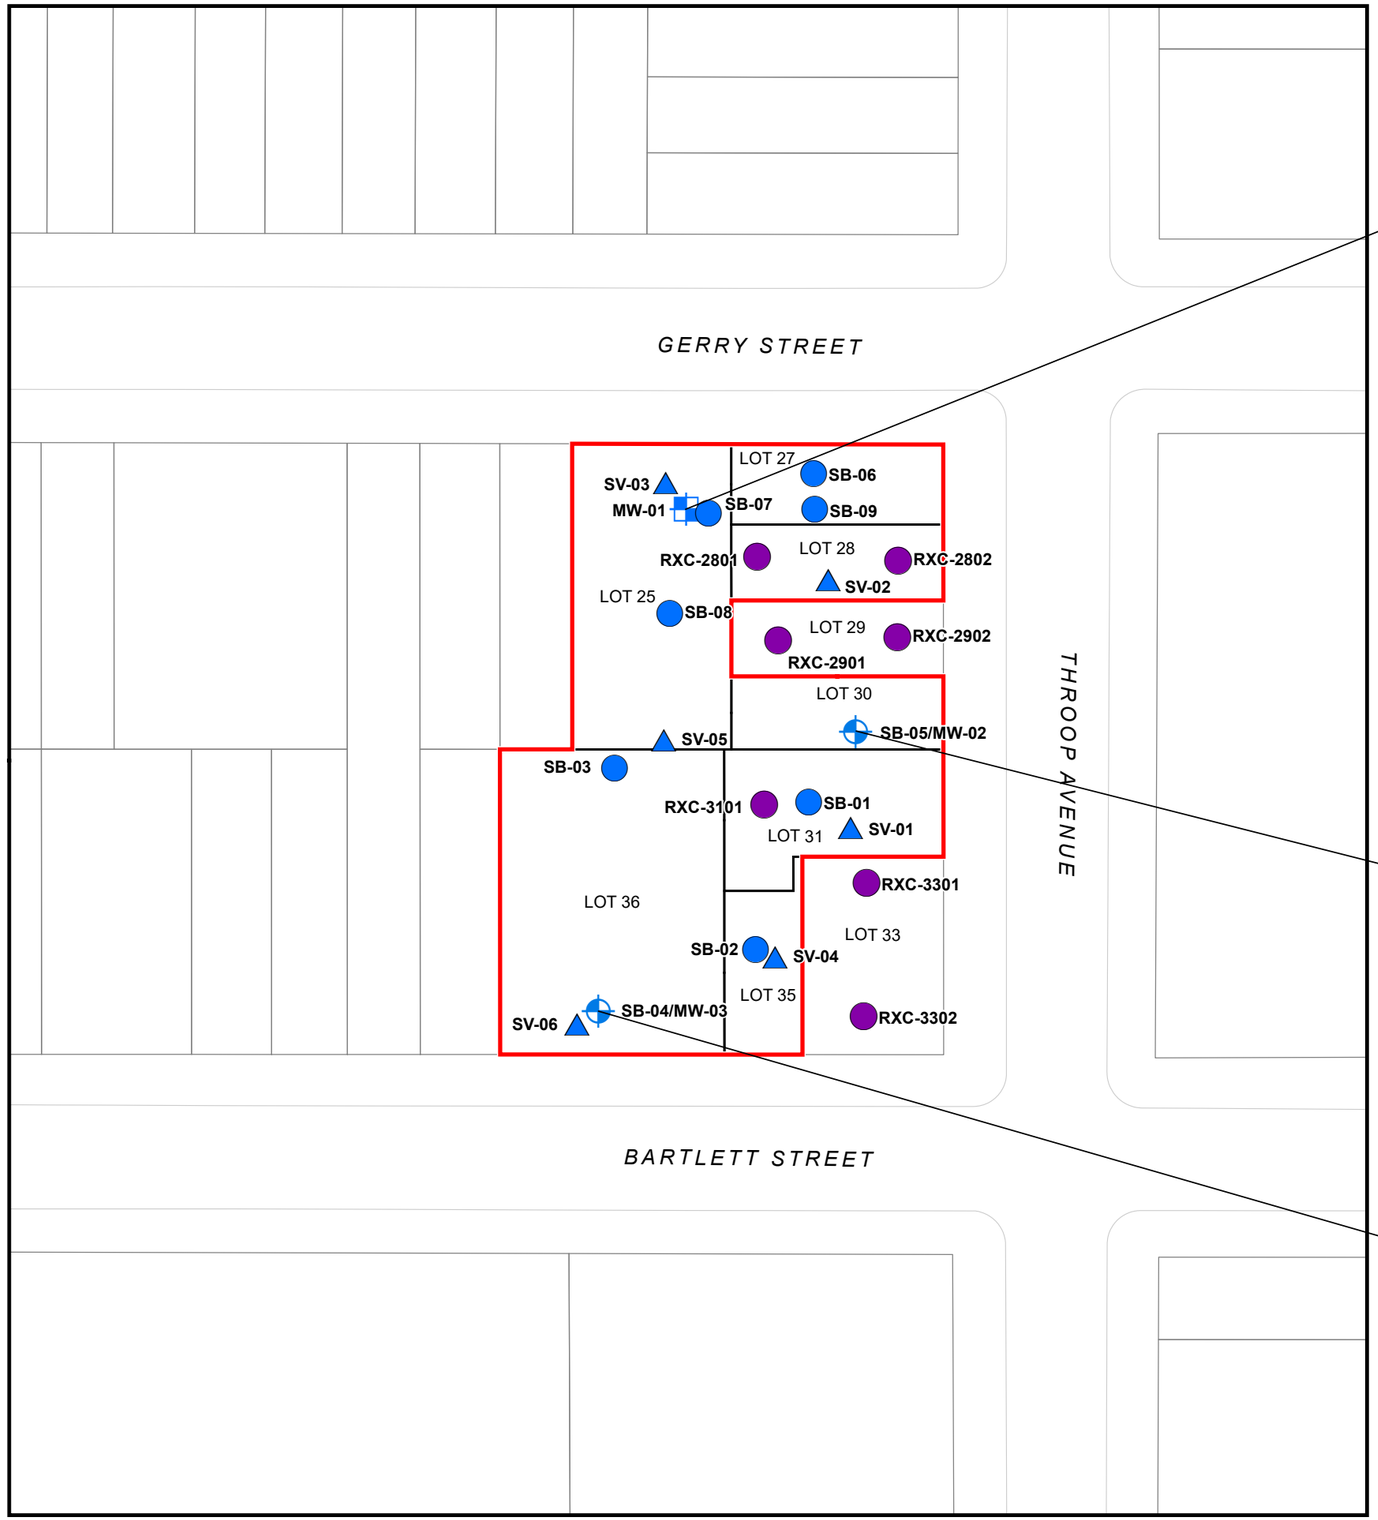

MW-01	4/14/2020
SVOCs	
Benzo(a)anthracene	**0.08**
Benzo(a)pyrene	**0.07**
Benzo(b)fluoranthene	**0.09**
Benzo(k)fluoranthene	**0.04**
Chrysene	**0.06**
Indeno(1,2,3-cd)pyrene	**0.05**
Metals (Total)	
Manganese	**496.5**
Metals (Dissolved)	
Manganese	**499.3**

MW-02	4/14/2020
Metals (Total)	
Manganese	**2103**
Sodium	**25800**
Metals (Dissolved)	
Manganese	**2115**
Sodium	**26200**

MW-03	4/14/2020
Metals (Total)	
Iron	**1380**
Magnesium	**71200**
Manganese	**537.4**
Metals (Dissolved)	
Magnesium	**71200**
Manganese	**526.5**

LEGEND

- LOCATION OF ROUX SOIL BORING
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL BORING COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL BORING AND GROUNDWATER SAMPLE COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES MONITORING WELL COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL VAPOR POINT COLLECTED IN 2020
- BCP SITE BOUNDARY

Parameter	NYSDEC AWQSGVs
SVOCs	
Benzo(a)anthracene	**0.002**
Benzo(a)pyrene	**0.002**
Benzo(b)fluoranthene	**0.002**
Benzo(k)fluoranthene	**0.002**
Chrysene	**0.002**
Indeno(1,2,3-cd)pyrene	**0.002**
Metals (Total)	
Iron	**300**
Magnesium	**35000**
Manganese	**300**
Sodium	**20000**
Metals (Dissolved)	
Magnesium	**35000**
Manganese	**300**
Sodium	**20000**

NOTES

1. ALL CONCENTRATIONS SHOWN IN MICROGRAMS PER LITER
2. BOLD DATA INDICATES AN EXCEEDANCE OF NYSDEC AWQSGV

AWQSGV - AMBIENT WATER-QUALITY STANDARDS AND GUIDANCE VALUES
NYSDEC - NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION
SVOCS - SEMIVOLATILE ORGANIC COMPOUNDS

50 0 50'

N

Title:

GROUNDWATER SAMPLE LOCATIONS AND EXCEEDANCES

BROADWAY TRIANGLE SITE C
59-69 BARTLETT ST, 84-100 THROOP AVE
AND 90-100 GERRY ST, BROOKLYN NY

Prepared for:
UNIFIED NEIGHBORHOOD PARTNERS LLC

ROUX

Compiled by: B.V.	Date: 07/19/21
Prepared by: M.S.R.	Scale: AS SHOWN
Project Mgr: B.V.	Project: 3605.0001Y003
File: 3605.0001Y111R.6.mxd	

FIGURE 6

V:\GIS\PROJECTS\3605\0001Y111R\3605.0001Y111R.6.MXD

SV-02	4/6/2020
VOCs	
1,3-Butadiene	**93**
2-Butanone	**50**
Acetone	**510**
Benzene	**31**
Carbon disulfide	**20**
Cyclohexane	**3.9**
Dichlorodifluoromethane	**3.5**
Ethylbenzene	**4.6**
Isopropanol	**8.9**
n-Heptane	**23**
n-Hexane	**41**
p/m-Xylene	**9.8**
Propylene	**530**
Tetrachloroethene	**30**
Toluene	**11**
Trichloroethene	**5.3**
Trichlorofluoromethane	**4.8**

SV-05	4/6/2020
VOCs	
1,2,4-Trimethylbenzene	**2**
2-Butanone	**15**
Acetone	**300**
Carbon disulfide	**20**
Chloroform	**3.2**
Cyclohexane	**3.8**
Dichlorodifluoromethane	**3.1**
Ethylbenzene	**7.5**
Isopropanol	**7.3**
Methyl Methacrylate	**1.4**
n-Heptane	**2.1**
n-Hexane	**2.2**
Propylene	**6.8**
Tetrachloroethene	**53**
Toluene	**1.7**
Trichlorofluoromethane	**2.7**

SV-06	4/6/2020
VOCs	
1,3-Butediene	**12**
2-Butanone	**26**
Acetone	**430**
Benzene	**4**
Carbon disulfide	**4.7**
Ethylbenzene	**4**
Isopropanol	**8.5**
n-Heptane	**4.1**
n-Hexane	**5.9**
o-Xylene	**4.7**
p/m-Xylene	**12**
Toluene	**4.1**

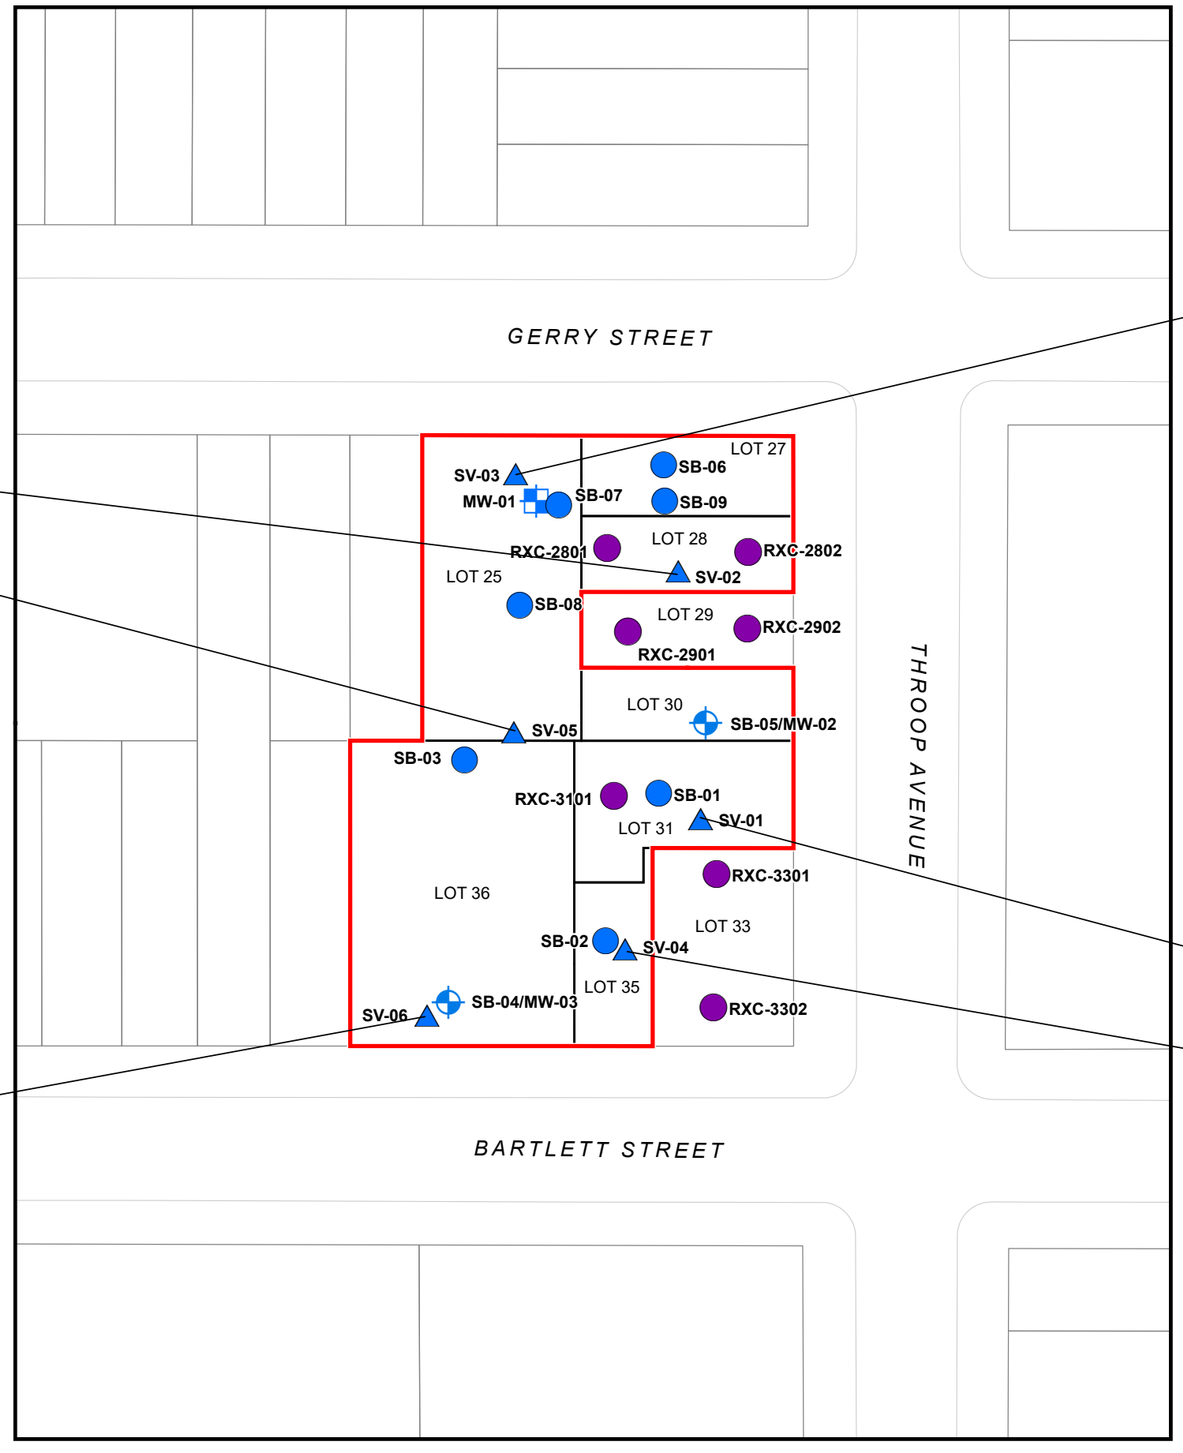

SV-03	4/6/2020
VOCs	
1,1,1-trichloroethane	**3.4**
2-Butanone	**19**
Acetone	**380**
Dichlorodifluoromethane	**2.8**
Ethylbenzene	**20.0**
Isopropanol	**6.7**
n-Heptane	**1.7**
Tetrachloroethene	**5**
Toluene	**2.7**

SV-01	4/6/2020
VOCs	
1,1,1-Trichloroethane	**1.1**
1,2,4-Trimethylbenzene	**2.2**
2-Butanone	**29**
2-Hexanone	**4.4**
4-Methyl-2-pentanone	**3.3**
Acetone	**540**
Benzene	**1.9**
Carbon disulfide	**1.9**
Chloroform	**2.4**
cis-1,2-Dichloroethene	**1.4**
Dichlorodifluoromethane	**2.1**
Ethylbenzene	**1.6**
Isopropanol	**7**
n-Heptane	**3**
n-Hexane	**1.4**
o-Xylene	**1.8**
p/m-Xylene	**4.5**
p-Ethyltoluene	**1.6**
Tetrachloroethene	**260**
Toluene	**10**
Trichloroethene	**18**
Trichlorofluoromethane	**11**

SV-04	4/6/2020
VOCs	
1,2,4-Trimethylbenzene	**1.8**
1,3-Butadiene	**3.2**
2-Butanone	**18**
4-Methyl-2-pentanone	**1.6**
Acetone	**340**
Carbon disulfide	**7.3**
Chloroform	**4**
Dichlorodifluoromethane	**2.8**
Isopropanol	**2.9**
n-Heptane	**5.4**
n-Hexane	**12**
Tetrachloroethene	**53**
Toluene	**2**
Trichlorofluoromethane	**11**

LEGEND

- LOCATION OF ROUX SOIL BORING
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL BORING COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL BORING AND GROUNDWATER SAMPLE COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES MONITORING WELL COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL VAPOR POINT COLLECTED IN 2020
- BCP SITE BOUNDARY

NOTES

1. ALL CONCENTRATIONS SHOWN IN MICROGRAMS PER CUBIC METER

   VOCS - VOLATILE ORGANIC COMPOUNDS

50 0 50'

Title:

SOIL VAPOR SAMPLE LOCATIONS AND DETECTIONS

BROADWAY TRIANGLE SITE C
59-69 BARTLETT ST, 84-100 THROOP AVE
AND 90-100 GERRY ST, BROOKLYN NY

Prepared for:

UNIFIED NEIGHBORHOOD PARTNERS LLC

ROUX

Compiled by: B.V.	Date: 07/19/21	FIGURE
Prepared by: M.S.R.	Scale: AS SHOWN	7
Project Mgr: B.V.	Project: 3605.0001Y003	
File: 3605.0001Y111R.7.mxd		

V:\GIS\PROJECTS\3605\0001Y\111R\3605.0001Y111R.7.MXD

LEGEND

- LOCATION OF PROPOSED RI SOIL BORING
- LOCATION OF PROPOSED RI SOIL BORING AND PERMANENT MONITORING WELL
- LOCATION OF PROPOSED RI SOIL BORING AND TEMPORARY SOIL VAPOR POINT
- LOCATION OF PROPOSED RI SOIL BORING, PERMANENT MONITORING WELL, AND TEMPORARY SOIL VAPOR POINT
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES MONITORING WELL COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL BORING COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL BORING AND GROUNDWATER SAMPLE COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL VAPOR POINT COLLECTED IN 2020
- LOCATION OF ROUX SOIL BORING
- ANTICIPATED GROUNDWATER FLOW DIRECTION
- BCP SITE BOUNDARY

NOTE

1. PROPOSED SAMPLE LOCATIONS ARE APPROXIMATE AND SUBJECT TO CHANGE

AOC - AREA OF CONCERN
BCP - BROWNFIELD CLEANUP PROGRAM
NYSDEC - NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION
RI - REMEDIAL INVESTIGATION

30 0 30'

Title:

PROPOSED REMEDIAL INVESTIGATION SAMPLE LOCATIONS

BROADWAY TRIANGLE SITE C
59-69 BARTLETT ST, 84-100 THROOP AVE
AND 90-100 GERRY ST, BROOKLYN NY

Prepared for:

UNIFIED NEIGHBORHOOD PARTNERS LLC

ROUX

Compiled by: B.V.	Date: 07/28/21	FIGURE
Prepared by: M.S.R.	Scale: AS SHOWN	8
Project Mgr: B.V.	Project: 3605.0001Y003	
File: 3605.0001Y111R.8.mxd		

V:\GIS\PROJECTS\3605\0001Y\111R\3605.0001Y111R.8.MXD

APPENDICES

A. Historic Reports (Provided on CD in Bound Copy)
B. Quality Assurance Project Plan/Field Sampling Plan
C. Community Air Monitoring Plan
D. Site Specific Health and Safety Plan (Provided on CD in Bound Copy)

APPENDIX A

Historic Reports
(Provided as Separate File)

APPENDIX B

Quality Assurance Project Plan/Field Sampling Plan

Quality Assurance Project Plan/ Field Sampling Plan

Broadway Triangle Site C
Block 2269
Lots 25, 27, 28, 30, 31, 35, 36
59-69 Bartlett Street,
84-100 Throop Avenue,
90-100 Gerry Street
Brooklyn, New York 11206

July 30, 2021

Prepared for:

Unified Neighborhood Partners LLC
2 Kingsland Avenue
Brooklyn, New York 11211

Prepared by:

Roux Environmental Engineering and Geology, D.P.C.
209 Shafter Street
Islandia, New York 11749

3605.0001Y114/CV

Environmental Consulting
& Management
+1.800.322.ROUX
rouxinc.com

Table of Contents

1. Introduction 1
   1.1 Purpose 1
2. Sampling Objectives 2
3. Project Organization 3
4. Sample Media, Locations, Analytical Suites, and Frequency 5
   4.1 Soil Sampling 5
   4.2 Groundwater Sampling 6
   4.3 Soil Vapor Sampling 7
5. Field Sampling Procedures 8
   5.1 Soil Sampling and Monitoring Well Installation 8
      5.1.1 Soil Sampling 8
      5.1.2 Monitoring Well Installation 8
   5.2 Groundwater Sampling 9
   5.3 Soil Vapor Sampling 9
6. Sample Handling and Analysis 11
   6.1 Field Sample Handling 11
   6.2 Sample Custody Documentation 11
   6.3 Sample Shipment 11
   6.4 Quality Assurance/Quality Control 12
7. Site Control Procedures 14
   7.1 Decontamination 14
   7.2 Waste Handling and Disposal 14

Tables

1. Proposed Soil Sampling Locations and Rationale
2. Proposed Groundwater Sampling Locations and Rationale
3. Proposed Soil Vapor Sampling Locations and Rationale
4. Field and Laboratory Quality Control Summary
5. Remedial Investigation Sampling Summary
6. Sample Preservation, Holding Times, and Containers Summary

Figures

1. Proposed Sample Location Map

Table of Contents (Continued)

Attachments

1. Professional Profiles
2. NYSDEC January 2021 PFAS Guidance
3. Laboratory Standard Operating Procedures and Certifications
4. Roux Standard Operating Procedures
5. Laboratory Chains of Custody

1. Introduction

Roux Environmental Engineering and Geology, D.P.C. (Roux), on behalf of Unified Neighborhood Partners, LLC (The Applicant), has prepared this Quality Assurance Project Plan/Field Sampling Plan (QAPP/FSP) to describe the measures that will be taken to ensure that the data generated during performance of the Remedial Investigation (RI) for the Broadway Triangle Site C project at 59-69 Bartlett Street, 84-100 Throop Avenue, and 90-100 Gerry Street in the Broadway Triangle section of Brooklyn, New York (Block 2269 and Lots 25, 27, 28, 30, 31, 35, and 36 of the New York City Tax Map [Site]) are of quality sufficient to meet project-specific data quality objectives (DQOs) to support the development of a Remedial Action Work Plan (RAWP). This QAPP/FSP also includes field sampling procedures.

The Applicant is in the process of applying as a Volunteer in the Brownfield Cleanup Program (BCP); once accepted, RI activities will be conducted under the New York State Department of Environmental Conservation (NYSDEC) Brownfield Cleanup Program (BCP). This QAPP/FSP was prepared in accordance with the guidance provided in NYSDEC Technical Guidance DER-10 Technical Guidance for Site Investigation and Remediation (DER-10), the NYSDEC BCP Guide, and the United States Environmental Protection Agency's (USEPA's) Guidance for the Data Quality Objectives Process (EPA QA/G 4).

1.1 Purpose

The QAPP/FSP describes in detail the field sampling and quality assurance/quality control (QA/QC) methods to be used during soil, soil vapor, and groundwater sampling tasks performed during the RI.

This QAPP/FSP was prepared in accordance with the NYSDEC's DER-10 and provides guidelines and procedures to be followed by field personnel during performance of sampling during the RI. Information contained in this QAPP/FSP relates to:

- sampling objectives (Section 2);
- project organization (Section 3);
- sample media, sampling locations, analytical suites, sampling frequencies and analytical laboratory (Section 4);
- field sampling procedures (Section 5);
- sample handling, sample analysis, and quality assurance/quality control (Section 6); and
- site control procedures and decontamination (Section 7).

2. Sampling Objectives

The objective of the proposed sampling is to determine the nature and extent of the known contamination at the Site, to evaluate any additional areas of concern (AOCs), and to obtain a current representation of the environmental conditions at the Site.

Roux has performed a preliminary Site reconnaissance and has identified potential AOCs. These areas will be targeted during the RI to rule out any impacts. An inspection of the existing Site conditions, as well as a geophysical survey, will be conducted to determine final locations of soil borings, monitoring wells, and soil vapor points based on actual field conditions.

Sampling procedures are discussed in Section 5 of this QAPP/FSP. A discussion of the DQOs and quality assurance/quality control is provided in Section 6.

3. Project Organization

A general and generic summary of the overall management structure and responsibilities of project team members are presented below. Professional profiles for the team are provided in Attachment 1.

Project Principal

Jessica L. Taylor, P.G. will serve as Project Principal. The Project Principal is responsible for defining project objectives and bears ultimate responsibility for the successful completion of the investigation.

Remedial Engineer

The Engineer of Record for this project will be Charles J. McGuckin, P.E. The Remedial Engineer is a registered professional engineer licensed by the State of New York. The Remedial Engineer will have primary direct responsibility for implementation of the RI and future remedial program for the Site. The Remedial Engineer will certify in the Remedial Investigation Report (RIR) that the investigation activities were observed by qualified environmental professionals under his supervision as well as any other relevant provisions of ECL 27-1419 have been achieved in full conformance with the RI.

Project Manager

Brandon Vella of Roux will serve as Project Manager. The Project Manager is responsible for defining project objectives and bears ultimate responsibility for the successful completion of the work. This individual will provide overall management for the implementation of the scope of work and will coordinate all field activities. The Project Manager is also responsible for data review/interpretation and report preparation.

Field Team Leader

The Field Team Leader will be Emily Butler of Roux. The Field Team Leader bears the responsibility for the successful execution of the field program. The Field Team Leader will direct the activities of the technical staff in the field, as well as all subcontractors. The Field Team Leader will also assist in the interpretation of data and in report preparation. The Field Team Leader reports to the Project Manager.

Site Health and Safety Officer

Emily Butler of Roux will serve as the Site Health and Safety Officer (SHSO). The SHSO has the full responsibility and authority to implement this HASP and to verify compliance. The SHSO reports to the Project Manager. The SHSO is on Site or readily accessible to the Site during all work operations and has the authority to halt Site work if unsafe conditions are detected.

Quality Assurance Officer

Levi Curnutte of Roux will serve as the Quality Assurance Officer (QAO) for this project. The QAO is responsible for conducting reviews, inspections, and audits to ensure that the data collection is conducted in accordance with the QAPP/FSP. The QAO's responsibilities range from ensuring effective field equipment decontamination procedures and proper sample collection to the review of all laboratory analytical data for completeness and usefulness.

Laboratory Project Manager

Laboratory analysis will be completed by Eurofins TestAmerica Laboratories of Edison, New Jersey and Burlington, Vermont, New York State Department of Health (NYSDOH) Environmental Laboratory Accreditation Program (ELAP)-certified laboratories (11452 and 10391, respectively). The Laboratory

Project Manager is Melissa Haas. The Laboratory Project Manager is responsible for sample container preparation, sample custody in the laboratory, and completion of the required analysis through oversight of the laboratory staff. The Laboratory Project Manager will ensure that quality assurance procedures are followed and that an acceptable laboratory report is prepared and submitted. The Laboratory Project Manager reports to the Project Principal and Project Manager.

Data Validator

Joshua Cope of Roux, who is independent from the project implementation team, will review the analytical data for quality assurance and quality control in accordance with NYSDEC standards. The Data Validator will prepare a Data Usability Summary Report (DUSR) meeting the requirements in Section 2.2(a)1.ii and Appendix 2B of DER-10 for all data packages generated for the RI.

4. Sample Media, Locations, Analytical Suites, and Frequency

The media to be sampled during the RI include soil, groundwater, and soil vapor. Sampling locations, analytical suites, and frequency vary by medium as shown in Tables 1 through 3. A discussion of the sampling scope for each medium is provided below. Specifics regarding the collection of samples at each location and for each medium are provided in Section 5 of this QAPP/FSP.

4.1 Soil Sampling

Soil samples are to be used to characterize the soil conditions for the AOCs at the Site, fill existing data gaps in vertical delineation of contamination, and to collect the data sufficient to define the nature and extent of impacted soils to support the development of a RAWP. Eleven soil borings are proposed to be installed at the locations as shown in Figure 1 and listed in Table 1 of the QAPP/FSP. One shallow and one deep soil sample are planned to be collected from each soil boring. Sample intervals will be biased towards native soils immediately underlying the apparent fill layer based on field observations while drilling. If odor/ visual evidence of contamination or elevated photoionization detector (PID) readings are noted, one additional sample may be collected from the interval that exhibits the greatest evidence of contamination. Soil sampling procedures are outlined in Section 5.1.

Analysis of soil samples will occur in a phased approach. Initially, the shallower of the two soil samples collected from beneath the fill layer at each borehole will be analyzed for the parameters listed below. If the result of that analysis for each borehole contains exceedances of UUSCOs, the deeper sample will also be analyzed to provide additional vertical delineation. Soil Samples will be submitted for the following laboratory analyses:

- TCL/Part 375 VOC + 10 Tentatively identified compounds (TICs);
- TCL/Part 375 Base neutral acids (BNA)/SVOCs + 20 TICs;
- TCL/Part 375 Pesticides;
- TCL/Part 375 Herbicides;
- TCL/Part 375 PCBs;
- TAL/Part 375 Metals (including trivalent chromium, hexavalent chromium, mercury); and
- Total Cyanide

Additionally, as required by NYSDEC, soil samples will be analyzed for the emerging contaminants (ECs) 1,4-Dioxane and PFAS, which include the 21 compounds listed in accordance with the Sampling, Analysis, and Assessment of PFAS under NYSDEC's Part 375 Remedial Programs guidance document (NYSDEC January 2021 PFAS Guidance). The 21 PFAS to be analyzed are:

- Perfluorobutanesulfonic acid (Pfbs);
- Perfluorohexanesulfonic acid (Pfhxs);
- Perfluoroheptanesulfonic acid (Pfhps);
- Perfluorooctancessulfonic acid (Pfos);
- Perfluorodecanesulfonic acid (Pfds);

- Perfluorobutanoics acid (Pfba);
- Perfluoropentanoic acid (Pfpea);
- Perfluorohexanoic acid (Pfhxa);
- Perfluoroheptanoic acid (Pfhpa);
- Perfluorooctanoic acid (Pfoa);
- Perfluorononanoic acid (Pfna);
- Perfluorodecanoic acid (Pfda);
- Perfluoroundecanoic acid (Pfuna);
- Perfluorododecanoic acid (Pfdoa);
- Perfluorotridecanoic acid (Pftrda);
- Perfluorotetradecanoic acid (Pfta);
- 6:2 Fluorotelomer sulfonate (6:2Fts);
- 8:2 Fluorotelomer sulfonate (8:2Fts);
- Perfluroroctanesulfonamide (Fosa);
- N-methyl perfluorooctanesulfonamidoacetic acid (Nmefosaa); and
- N-ethyl perfluorooctanesulfonamidoacetic acid (Netfosaa).

A copy of the January 2021 Guidance is included in Attachment 2. Laboratory reporting limits for each of the 21 PFAS in soil analyzed via Modified Method 537 range from 0.200 to 2.000 micrograms per kilogram. The laboratory reporting limit for 1,4-Dioxane in soil analyzed via USEPA Method 8270 SIM is 0.100 milligrams per kilogram. The Eurofins TestAmerica Standard Operating Procedures (SOPs) for completing ECs analysis and a complete listing of reporting limits/minimum detection limits for EC compounds are included in Attachment 3.

4.2 Groundwater Sampling

To characterize on-Site groundwater flow and quality conditions, five permanent groundwater monitoring wells will be installed and sampled. Based on data from previous environmental reports, the average depth to groundwater is approximately 10-ft bls. Five permanent groundwater monitoring wells will be installed to a maximum depth of approximately 20 feet below land surface (ft bls). All monitoring wells will be installed with at least ten-ft of well screen bridging the water table. The proposed groundwater monitoring well locations are shown on Figure 1 and listed in Table 2 of the QAPP/FSP. Monitoring well installation and groundwater sampling procedures are outlined in Section 5.2.

Groundwater samples will be collected from the monitoring wells and submitted for the following laboratory analysis:

- TCL/Part 375 VOC + 10 Tentatively identified compounds (TICs);
- TCL/Part 375 Base neutral acids (BNA)/SVOCs + 20 TICs;
- TCL/Part 375 Pesticides;
- TCL/Part 375 Herbicides;
- TCL/Part 375 PCBs;

- TAL/Part 375 Metals (including trivalent chromium, hexavalent chromium, mercury); and
- Total Cyanide.

Groundwater samples will be filtered by the laboratory for metals and both filtered and unfiltered results will be reported.

Additionally, as required by NYSDEC, groundwater samples will also be analyzed for the ECs 1,4-Dioxane and PFAS, which include the 21 compounds listed in the NYSDEC January 2021 Guidance. Refer to Section 4.1 for a complete listing of the 21 PFAS. The laboratory reporting limit for 1,4-Dioxane in groundwater analyzed via USEPA Method 8270 SIM is 0.200 micrograms per liter. Laboratory reporting limits for each of the 21 PFAS in groundwater analyzed via Modified Method 537 range from and 2.00 to 5.00 nanograms per liter. The Eurofins TestAmerica SOPs for completing ECs analysis and a complete listing of reporting limits/minimum detection limits for EC compounds are included in Attachment 3.

4.3 Soil Vapor Sampling

Five soil vapor samples will be collected during the RI to evaluate soil vapor conditions at the Site. The proposed soil vapor sampling locations are shown on Figure 1 and listed in Table 3 of the QAPP/FSP. All soil vapor samples will be collected in accordance with the October 2006 and Revised 2017 NYSDOH Guidance for Evaluating Soil Vapor Intrusion in the State of New York. All soil vapor samples will be collected from a depth of approximately 2-ft above the apparent water table based on field observations while drilling. All soil vapor samples will be analyzed for VOCs using USEPA Method TO-15. Soil vapor point installation and soil vapor sampling procedures are outlined in Section 5.3

5. Field Sampling Procedures

This section provides a detailed discussion of the field procedures to be used during sampling of the various media being evaluated as part of the RI (i.e., soil, groundwater, and soil vapor). As discussed, the sample locations are shown on Figure 1 and additional information including intervals to be sampled and sample rationale is provided in Tables 1 through 3 the QAPP/FSP. Additional details regarding sampling procedures and protocols are described in Roux's relevant SOPs, which are provided in Attachment 4.

5.1 Soil Sampling and Monitoring Well Installation

Details for the collection of soil samples and the installation of monitoring wells are provided below. Boreholes will be pre-cleared to five ft bls using non-intrusive methods (i.e., hand auger, vacuum technology, etc.) prior to advancement of soil borings to verify the absence of potential underground utilities. Should a utility or other feature be observed during pre-clearance activities, the sampling location will be relocated no more than ten feet away from the original proposed location. Should the sampling location need to be relocated at a distance greater than ten feet from the original proposed location due to access constraints, Roux will contact the NYSDEC project manager to confirm.

5.1.1 Soil Sampling

Soil borings will be advanced using a GeoProbe® Direct-Push drill rig. Samples of the soil profile will be collected continuously from land surface to a maximum depth of approximately 15 ft bls for soil borings or approximately 20 ft bls for monitoring wells, as listed in Table 1 of the QAPP/FSP.

The soil from each five foot interval will be observed for lithology and evidence of contamination (e.g., staining, odors, and/or visible free-product) and placed immediately thereafter into large Ziploc® bags for recording headspace. After a minimum of 15 minutes for equilibration with the headspace in the Ziploc® bag, each sample will be screened for organic vapors using a photoionization detector (PID) equipped with a 10.6 eV lamp. Soil samples will be collected according to Table 1 of the QAPP/FSP. These samples will be placed in the laboratory-supplied containers and shipped to the laboratory under chain of custody procedures in accordance with Roux's SOPs in Attachment 4.

Following sample collection, boreholes that will not be converted into monitoring wells or temporary soil vapor points will instead will be backfilled to grade with visibly unimpacted soil cuttings or clean sand and capped with a bentonite plug. Contaminated soil cuttings, if encountered, will be placed in sealed and labeled U.S. Department of Transportation (DOT) approved 55-gallon drums pending characterization and off-Site disposal at a permitted facility.

5.1.2 Monitoring Well Installation

Following soil sampling activities, five soil borings will be converted to permanent monitoring wells using a GeoProbe® drill rig equipped with hollow stem augers. Monitoring wells will be constructed of 2-inch inside diameter, Schedule 40 polyvinyl chloride (PVC) casing with at least 10 feet of 0.020-inch slot machined Schedule 40 PVC screen. Well screens will be installed to straddle the water table. A sand pack will be placed around the well screen, extending from the bottom of the screen up to two feet above the top of the screened zone. Once the driller confirms the depth of the sand pack, a minimum two-foot thick bentonite pellet seal will be placed above the sand pack and hydrated using potable water. Once the pellets have been allowed to hydrate, a cement bentonite grout slurry will be pumped into the remaining annular space

from the top of the bentonite seal to less than 1-ft bls. The wells will be completed using locking well J-plugs and secured using flush-mounted, bolt-down, water-tight, manhole covers set within a concrete pad. High-visibility markers or stakes will be inserted into the ground next to each finished well to aid in locating the wells during any future monitoring events.

Each newly installed monitoring well will be developed to remove any fine grained material in the vicinity of the well screen and to promote hydraulic connection with the surrounding aquifer. The wells will be developed using a submersible pump, which will be surged periodically along the entire length of the screen until well yield is consistent and has a turbidity below 50 Nephelometric turbidity units (NTUs) or appears generally free of sediment based on visual observations.

5.2 Groundwater Sampling

Groundwater samples will be collected no sooner than one week following development of the wells. Prior to sampling, depth to water will be measured at each well using an electronic oil-water level meter with an accuracy of +/ 0.01 feet. All wells will then be purged and sampled using low-flow methods. Purging and sampling will be performed consistent with USEPA low-flow sampling requirements. Field parameters (e.g., temperature, pH, dissolved oxygen, oxidation-reduction potential [ORP], conductivity, and turbidity) as described in the USEPA low-flow sampling requirements) will be collected using a water quality meter with flow-through cell until parameters have stabilized before samples are collected. Samples will be analyzed for TCL + 30/TAL as shown on Tables 2 and 5.

Monitoring wells will be analyzed for the NYSDEC-required ECs in addition to the TCL + 30/TAL list. Additional necessary precautions will be taken when sampling for ECs in the field including, but not limited to:

- Using the proper field clothing or personal protective equipment (i.e., no materials will contain Gore-Tex or Tyvek);
- Avoid using Grundfos and bladder pumps and sampling equipment components/containers making contact with aluminum foil, low density polyethylene (LDPE), glass, or polytetrafluoroethylene (Teflon®) materials;
- Following PFAS field sampling guidelines (i.e., using sampling materials made from high density polyethylene [HDPE], silicon, or stainless steel and avoid using equipment containing Teflon® and using sharpies, permanent markers, adhesives, and waterproof/plastic clipboards and notebooks); and
- Utilizing regular ice for sample presevation and only Alconox or Liquinox for decontamination.

All groundwater samples will be collected and placed in the laboratory-supplied containers and shipped to the laboratory under chain of custody procedures in accordance with Roux's field sampling SOPs included as Attachment 4.

5.3 Soil Vapor Sampling

Five soil vapor samples will be collected during the RI to evaluate soil vapor concentrations at the Site. The soil vapor samples will be collected from a depth of approximately 2-ft above the apparent water table based on field observations during soil boring and monitoring well installation activities. New Teflon® lined tubing will be attached to an expendable soil vapor sampling point consisting of a 6-inch stainless steel screen. The soil vapor points will be backfilled with #2 Morie sand to approximately one foot above the screen followed by a 2 foot thick hydrated bentonite seal. The remainder of the borehole will be backfilled with a cement/bentonite grout slurry to grade.

Prior to sample collection, the Teflon®-lined tubing will be purged of approximately two volumes of the tubing using a vacuum pump set at a rate of 0.2 liters per minute. A tracer gas (i.e., helium) will be used to enrich the atmosphere in the immediate vicinity of the sampling location in order to test the borehole seal and verify that ambient air is not being inadvertantly drawn into the sample in accordance with the procedures outlined in the NYSDOH Guidance. Following purging and seal verification with the tracer gas, the tubing will be connected to the pre-cleaned (batch-certified) laboratory supplied 6-liter summa canister. All soil vapor samples will be collected using the canisters with regulators certified and calibrated by the laboratory to collect samples over a two-hour period at a flow rate of 200 millileters per minute. Soil vapor samples will be analyzed using USEPA Method TO-15 for VOCs.

6. Sample Handling and Analysis

To ensure quality data acquisition and collection of representative samples, there are selective procedures to minimize sample degradation or contamination. These include procedures for preservation of the samples, as well as sample packaging, shipping procedures, and QA/QC.

6.1 Field Sample Handling

A discussion of the proposed number and types of samples to be collected during each task, as well as the analyses to be performed, can be found in Section 4 of this QAPP/FSP. The types of containers, volumes, and preservation techniques for the aforementioned testing parameters are presented in Table 6 of the QAPP/FSP.

6.2 Sample Custody Documentation

The purpose of documenting sample custody is to ensure that the integrity and handling of the samples is not subject to question. Sample custody will be maintained from the point of sampling through the analysis (and return of unused sample portion, if applicable).

Each individual collecting samples is personally responsible for the care and custody of the samples. All sample labels should be pre printed or filled out using waterproof ink. The technical staff will review all field activities with the Field Team Leader to determine whether proper custody procedures were followed during the field work and to decide if additional samples are required.

All samples being shipped off-Site for analysis must be accompanied by a properly completed chain of custody form. The sample identifiers will be listed on the chain of custody form. When transferring the possession of samples, individuals relinquishing and receiving will sign, date, and note the time on the record. This record documents transfer of custody of samples from the sampler to another person, to/from a secure storage area, and to the laboratory. Blank copies of the laboratory chains of custody to be used for soil, groundwater, and soil vapor samples are provided in Attachement 5.

Samples will be packaged for shipment and dispatched to the appropriate laboratory for analysis with a separate signed custody record enclosed in each sample box or cooler. Shipping containers will be locked and/or secured with tape in at least two locations for shipment to the laboratory.

6.3 Sample Shipment

If sample shipment is necessary, sample packaging and shipping procedures are based upon USEPA specifications as well as DOT regulations. The procedures vary according to potential sample analytes, concentration, and matrix, and are designed to provide optimum protection for the samples and the public. Sample packaging and shipment must be performed using the general outline described below.

All samples will be shipped within 24 hours of collection and will be preserved appropriately from the time of sample collection. A description of the sample packing and shipping procedures is presented below:

1. Prepare cooler(s) for shipment:
   - tape drain(s) of cooler shut;
   - affix “This Side Up” arrow labels and “Fragile” labels on each cooler; and

– place mailing label with laboratory address on top of cooler(s).

2. Arrange sample containers in groups by sample number.
3. Ensure that all bottle labels are completed correctly. Place clear tape over bottle labels to prevent moisture accumulation from causing the label to peel off.
4. Arrange containers in front of assigned coolers.
5. Place packaging material approximately at the bottom of the cooler to act as a cushion for the sample containers.
6. Arrange containers in the cooler so that they are not in contact with the cooler or other samples.
7. Fill remaining spaces with packaging material.
8. Ensure all containers are firmly packed in packaging material.
9. If ice is required to preserve the samples, ice cubes should be repackaged in Zip-lock™ bags and placed on top of the packaging material.
10. Sign chain of custody form (or obtain signature) and indicate the time and date it was relinquished to courier as appropriate.
11. Separate chain of custody forms. Seal proper copies within a large Zip-loc™ bag and tape to inside cover of cooler. Retain copies of all forms.
12. Close lid and latch.
13. Secure each cooler using custody seals.
14. Tape cooler shut on both ends.
15. Relinquish to overnight delivery service as appropriate. Retain air bill receipt for project records. (Note: All samples will be shipped for "NEXT A.M." delivery).

6.4 Quality Assurance/Quality Control

Joshua Cope of Roux, who is independent from the project implementation team, will review the analytical data for quality assurance and quality control in accordance with NYSDEC standards. The professional profile for Joshua Cope is provided in Attachment 1.

The primary intended use for the RI data is to characterize Site conditions and determine if remediation needs to be undertaken at the Site. The primary DQO of the soil, groundwater, and soil vapor programs, therefore, is that data be accurate and precise, and hence representative of the actual Site conditions. Accuracy refers to the ability of the laboratory to obtain a true value (i.e., compared to a standard) and is assessed through the use of laboratory quality control (QC) samples, including laboratory control samples and matrix spike samples, as well as through the use of surrogates, which are compounds not typically found in the environment that are injected into the samples prior to analysis. Precision refers to the ability to replicate a value and is assessed through both field and laboratory duplicate samples.

Sensitivity is also a critical issue in generating representative data. Laboratory equipment must be of sufficient sensitivity to detect target compounds and analytes at levels below NYSDEC standards and guidelines whenever possible. Equipment sensitivity can be decreased by field or laboratory contamination of samples, and by sample matrix effects. Assessment of instrument sensitivity is performed through the analysis of reagent blanks, near-detection-limit standards, and response factors. Potential field and/or laboratory contamination is assessed through use of trip blanks, method blanks, and equipment rinse blanks (also called "field blanks").

Table 4 of the QAPP/FSP lists the requirements for field and laboratory QC samples that will be analyzed to assess data accuracy and precision, as well as to determine if equipment sensitivity has been compromised. Table 5 of the QAPP/FSP lists the number/type of field and QA/QC samples that will be collected during the RI. Table 6 of the QAPP/FSP lists the preservation, holding times and sample container information.

All RI "assessment" analyses (i.e., TCL plus 30/ TAL and TO-15) will be performed in accordance with the NYSDEC Analytical Services Protocol (ASP), using USEPA SW 846 methods.

All laboratory data are to be reported in NYSDEC ASP Category B deliverables and will be delivered to NYSDEC in electronic data deliverable (EDD) format as described on NYSDEC's website (http://www.dec.ny.gov/chemical/62440.html). A Data Usability Summary Report (DUSR) will be prepared meeting the requirements in Section 2.2(a)1.ii and Appendix 2B of DER-10 for all data packages generated for the RI.

7. Site Control Procedures

Site control procedures, including decontamination and waste handling and disposal, are discussed below. Site control procedures have been developed to minimize both the risk of exposure to contamination and the spread of contamination during field activities at the Site. All personnel who come into designated work areas, including contractors and observers, will be required to adhere strictly to the conditions imposed herein and to the provisions of a Site-Specific Health and Safety Plan (HASP). The HASP is included as Appendix D to the RIWP.

7.1 Decontamination

In an attempt to avoid the spread of contamination, all drilling and sampling equipment must be decontaminated at a reasonable frequency. Detailed procedures for the decontamination of field and sampling equipment are included in Roux's SOPs for the Decontamination of Field Equipment located in Attachment 4 of the QAPP/FSP. All wash water generated during decontamination will be collected and containerized for proper disposal. As mentioned above, only Alconox or Liquinox will be used during decontamination procedures. Only PFAS-free water and Alconox will be used for decontamination purposes when decontaminating non-dedicated equipment associated with the collection of samples for PFAS analysis.

7.2 Waste Handling and Disposal

All waste materials (drill cuttings, decontamination water, well development/purge water etc.) generated during the RI will be consolidated, stored in appropriately labeled bulk containers (drums, etc.), and temporarily staged at an investigation derived waste storage area on-Site. Roux will then coordinate waste characterization and disposal by appropriate means. Investigation derived waste (IDW) will not be stored on-Site for longer than 90 days.

TABLES

1. Proposed Soil Sampling Locations and Rationale
2. Proposed Groundwater Sampling Locations and Rationale
3. Proposed Soil Vapor Sampling Locations and Rationale
4. Field and Laboratory Quality Control Summary
5. Remedial Investigation Sampling Summary
6. Sample Preservation, Holding Times, and Containers Summary

Table 1. Proposed Soil Sampling Locations and Rationale

Location	Matrix	Sample Intervals[1]	Approximate Maximum Depth	Sample Parameters	Rationale
RXC-2501	Soil	11-13 ft bls 13-15 ft bls	20 ft bls	TCL + 30/TAL ECs	Evaluate soil quality in the hydraulically upgradient area of the Site along the northwestern property boundary. Fill is anticipated to extend from grade to 9-10 ft bls in this area.
RXC-2502	Soil	7-9 ft bls 9-11 ft bls	15 ft bls	TCL + 30/TAL ECs	Vertically delineate metals contamination previously identified at SB-07. Fill is anticipated to extend from grade to 9-10 ft bls at SB-07.
RXC-2503	Soil	10-12 ft bls 12-14 ft bls	15 ft bls	TCL + 30/TAL ECs	Evaluate soil quality in the hydraulically upgradient area of the Site along the western property boundary. Fill is anticipated to extend from grade to 9-10 ft bls in this area.
RXC-2701	Soil	7-9 ft bls 9-11 ft bls	15 ft bls	TCL + 30/TAL ECs	Evaluate soil quality in the immediate vicinity of the NYSDEC Spill No. 2001570 AOC. Fill is anticipated to extend from grade to 6 ft bls in the spill AOC.
RXC-2702	Soil	7-9 ft bls 9-11 ft bls	20 ft bls	TCL + 30/TAL ECs	Evaluate soil quality in the immediate vicinity of the NYSDEC Spill No. 2001570 AOC. Fill is anticipated to extend from grade to 6 ft bls in the spill AOC.
RXC-2803	Soil	6-8 ft bls 8-10 ft bls	15 ft bls	TCL + 30/TAL ECs	Vertically delineate metals contamination previously identified at RXC-2802. Fill is anticipated to extend from grade to at least 5 ft bls at RXC-2802.
RXC-2903	Soil	6-8 ft bls 8-10 ft bls	15 ft bls	TCL + 30/TAL ECs	Evaluate soil quality in the hydraulically downgradient area of the Site along the northeastern property boundary. Fill is anticipated to extend from grade to at least 5 ft bls in this area.
RXC-3102	Soil	6-8 ft bls 8-10 ft bls	15 ft bls	TCL + 30/TAL ECs	Evaluate soil quality in the hydraulically downgradient area of the Site along the southeastern property boundary. Fill is anticipated to extend from grade to at least 5 ft bls in this area.
RXC-3303	Soil	6-8 ft bls 8-10 ft bls	20 ft bls	TCL + 30/TAL ECs	Evaluate soil quality in the hydraulically downgradient area of the Site along the southeastern property boundary. Fill is anticipated to extend from grade to at least 5 ft bls in this area.
RXC-3501	Soil	7-9 ft bls 9-11 ft bls	15 ft bls	TCL + 30/TAL ECs	Evaluate soil quality in the immediate vicinity of the historic automotive repair AOC and vertically delineate metals contamination previously identified at SB-02. Fill is anticipated to extend from grade to 6 ft bls in the automotive repair AOC.
RXC-3601	Soil	7-9 ft bls 9-11 ft bls	15 ft bls	TCL + 30/TAL ECs	Evaluate soil quality in the hydraulically upgradient area of the Site along the southwestern property boundary. Fill is anticipated to extend from grade to 4-6 ft bls in this area.

Depths are in feet below land surface; Additional intervals may be added based on field observations.

1 - Actual sample intervals will be biased towards native soils immediately underlying the apparent fill layer based on field observations. The deeper interval collected will be held pending the results of the shallower soil sample. Additional intervals may be added based on field observations.

Laboratory will report to their minimum possible standards for each method (QAPP Appendix D)

AOC - Area of Concern

ECs - 21 Per- and Polyfluoroalkyl Substances (PFAS), 1,4-Dioxane

ft bls - Feet Below Land Surface

SVOCs - Semivolatile Organic Compounds

PCBs - Polychlorinated Biphenyls

QA/QC samples will be collected as described in the QAPP Table 2

TAL - USEPA Contract Laboratory Program Target Analyte List

TCL + 30/TAL - includes TCL VOCs + 10 TICs, TCL SVOCs + 20 TICs, TCL Pest/Herb/PCBs, TAL Metals, Hex/Tri Chromium, Total Cyanide, Total Mercury

TCL - USEPA Contract Laboratory Program Target Compound List

TICs - Tentatively Identified Compounds

VOCs - Volatile Organic Compounds

Table 2. Proposed Groundwater Sampling Locations and Rationale

Location	Matrix	Proposed Monitoring Well Depth*	Sample Interval	Sample Parameters	Rationale
RXC-2501	Groundwater	Screened to 7 ft below water table	Water Table	TCL + 30/TAL ECs	Evaluate groundwater quality in the hydraullically upgradient area of the Site along the western property boundary.
RXC-2702	Groundwater	Screened to 7 ft below water table	Water Table	TCL + 30/TAL ECs	Evaluate groundwater quality in the area immediately downgradient of the NYSDEC Spill No. 2001570 AOC.
RXC-3102	Groundwater	Screened to 7 ft below water table	Water Table	TCL + 30/TAL ECs	Evaluate groundwater quality in the hydraullically downgradient area of the Site relative to the historic automotive repair AOC and address a groundwater quality data gap.
RXC-3501	Groundwater	Screened to 7 ft below water table	Water Table	TCL + 30/TAL ECs	Evaluate groundwater quality in the vicinity of the former automotive repair AOC.
RXC-3601	Groundwater	Screened to 7 ft below water table	Water Table	TCL + 30/TAL ECs	Evaluate groundwater quality in the hydraullically upgradient area of the Site along the western property boundary.

*Proposed monitoring well depth based on previously identified depth to water from prior investigations
Laboratory will report to their minimum possible standards for each method (QAPP Appendix D)
AOC - Area of Concern
ECs - 21 Per- and Polyfluoroalkyl Substances (PFAS), 1,4-Dioxane
ft bls - feet below land surface
NYSDEC - New York State Department of Environmental Conservation
PCBs - Polychlorinated Biphenyls
QA/QC samples will be collected as described in the QAPP Table 2
SVOCs - Semivolatile Organic Compounds
TAL - USEPA Contract Laboratory Program Target Analyte List
TICs - Tentatively Identified Compounds
TCL + 30/TAL - includes TCL VOCs + 10 TICs, TCL BNA (SVOCs) + 20 TICs, TCL Pest/PCBs, TAL Metals, Hex/Tri Chromium, Total Cyanide, Total Mercury
TCL - USEPA Contract Laboratory Program Target Compound List
VOCs - Volatile Organic Compounds
All groundwater samples will be analyzed for both filtered and unfiltered metals

Table 3. Proposed Soil Vapor Sampling Locations and Rationale

Locations	Matrix	Sample Interval	Sample Parameters	Sampling Method	Rationale
RXC-2701	Soil Vapor	At locations from approximately 2 feet above the water table.	TCL VOCs	TO-15	Evaluate soil vapor quality beneath the Site in the immediate vicinity of the NYSDEC Spill No. 2001570 AOC.
RXC-2702	Soil Vapor	At locations from approximately 2 feet above the water table.	TCL VOCs	TO-15	Evaluate soil vapor quality beneath the Site in the immediate vicinity of the NYSDEC Spill No. 2001570 AOC.
RXC-3102	Soil Vapor	At locations from approximately 2 feet above the water table.	TCL VOCs	TO-15	Evaluate soil vapor quality in the hydraullically downgradient area of the Site relative to the historic automotive repair AOC.
RXC-3501	Soil Vapor	At locations from approximately 2 feet above the water table.	TCL VOCs	TO-15	Evaluate soil vapor quality in the vicinity of the former automotive repair AOC.
RXC-3601	Soil Vapor	At locations from approximately 2 feet above the water table.	TCL VOCs	TO-15	Evaluate soil vapor quality in the hydraullically downgradient area of the Site along the southwestern property boundary.

Laboratory will report to their minimum possible standards for each method (QAPP Appendix D)
AOC - Area of Concern
NYSDEC - New York State Department of Environmental Conservation
QA/QC samples will be collected as described in the QAPP Table 2
TCL - USEPA Contract Laboratory Program Target Compound List
TICs - Tentatively Identified Compounds
VOCs - Volatile Organic Compounds

Table 4. Field and Laboratory Quality Control Summary

QC Check Type	Minimum Frequency	Use
Field QC		
Duplicate	1 per matrix per 20 samples or SDG	Precision
Trip Blank	1 per VOC cooler	Sensitivity
Field Blank	1 per matrix per 20 samples	Sensitivity
PFAS Field Blank	1 per day when sampling for PFAS	Sensitivity
Laboratory QC		
Laboratory Control Sample	1 per matrix per SDG	Accuracy
Matrix Spike/Matrix Spike Duplicate/Matrix Duplicate	1 per matrix per SDG	Accuracy/Precision
Surrogate Spike	All organics samples	Accuracy
Laboratory Duplicate	1 per matrix per SDG	Precision
Method Blank	1 per matrix per SDG	Sensitivity

* SDG - Sample Delivery Group - Assumes a single extraction or preparation
** Provided to lab by field sampling personnel
PFAS - Per- and Polyfluoroalkyl Substances
QC - Quality Control

Table 5. Remedial Investigation Sampling Summary

Sample Medium	Target Analytes	Field Samples	Replicates[1]	Trip Blanks[2]	Field Blanks[3]	Matrix Spikes[1]	Spike Duplicates[1]	Total No. of Samples
Soil	TCL VOCs +10	22	2	5	2	2	2	35
	TCL SVOCs +20 +1,4-Dioxane	22	2	-	2	2	2	30
	TCL Pesticides	22	2	-	2	2	2	30
	TCL Herbicides	22	2	-	2	2	2	30
	TCL PCBs	22	2	-	2	2	2	30
	TAL Metals + Hex/Trivalent Cr + Hg	22	2	-	2	2	2	30
	Total Cyanide	22	2	-	2	2	2	30
	PFAS	22	2	-	5	2	2	33
Groundwater	TCL VOCs +10	5	1	1	1	1	1	10
	TCL SVOCs +20	5	1	-	1	1	1	9
	TCL Pesticides	5	1	-	1	1	1	9
	TCL Herbicides	5	1	-	1	1	1	9
	TCL PCBs	5	1	-	1	1	1	9
	TAL Metals + Hex/Trivalent Cr + Hg	5	1	-	1	1	1	9
	Total Cyanide	5	1	-	1	1	1	9
	1,4-Dioxane	5	1	-	1	1	1	9
	PFAS	5	1	-	1	1	1	9
Soil Vapor	TO-15 VOCs	5	1	-	-	-	-	6

Totals are estimated based on scope of work as written, actual sample quantities may vary based on field conditions. QA/QC sample quantities will be adjusted accordingly.

[1] Based on 1 per 20 samples or 1 per Sample Delivery Group (5 days max)

[2] Based on 1 cooler per day (5 days max)

[2] Based on 1 per day when sampling for PFAS (5 days max)

Cr - Chromium

Hg - Mercury

SVOCs - Semivolatile Organic Compounds

PCBs - Polychlorinated Biphenyls

PFAS - Per- and Polyfluoroalkyl Substances

TAL - USEPA Contract Laboratory Program Target Analyte List

TCL - USEPA Contract Laboratory Program Target Compound List

USEPA - United States Environmental Protection Agency

VOCs - Volatile Organic Compounds

*All groundwater samples will be analyzed for both filtered and unfiltered metals.

Table 6. Sample Preservation, Holding Times, and Containers Summary

Analysis	Matrix	Bottle Type	Preservation(a)	Holding Time(b)
TAL Metals (total) SW-846 6020B/7471B/7470A	Soil Water	8 oz glass 250 mL plastic	Cool 4 ± 2°C Nitric acid	180 days, Hg 28 days
PFAA via EPA 537(M)-Isotope Dilution (SOIL)	Soil	4 or 8 oz HDPE bottle	Cool 0-6°C	14 days to extraction, 40 days from extraction to analysis
PFAA via EPA 537(M)-Isotope Dilution (WATER)	Water	Two 250 mL HDPE bottles	Cool 0-6°C	14 days to extraction, 40 days from extraction to analysis
Total Cyanide SW-846 9012B	Soil	8 oz glass 250 mL plastic	Cool 4 ± 2°C Soidum Hydroxide	14 days from sample collection 14 days from sample collection
1,4-Dioxane via 8270E SIM	Water	Two 250 mL amber glass	Cool 4 ± 2°C	7 days to extraction, 40 days from extraction to analysis
TO-15	Air	6 liter Summa Canister	None	30 days from sample collection
Target Compound List (TCL)				
TCL Volatile Organic Compounds (VOCs) SW-846 8260D	Soil Water	Three 5 gram Encores Three 40mL voa vials	Cool 4 ± 2°C Hydrochloric Acid	48 hours to extract, 14 days (from collection) to analysis 14 days from sample collection
TCL Semivolatile Organic Compounds (SVOCs) SW-846 8270E	Soil Water	8 oz glass Two 250 mL amber glass	Cool 4 ± 2°C	14 days to extract, 40 from extraction days to analysis 7 days to extract, 40 from extraction days to analysis
TCL Pesticides SW-846 8081B	Soil Water	8 oz glass Two 250 mL amber glass	Cool 4 ± 2°C	14 days to extract, 40 from extraction days to analysis 7 days to extract, 40 from extraction days to analysis
TCL Herbicides SW-846 8151A	Soil Water	8 oz glass Two 250 mL amber glass	Cool 4 ± 2°C	14 days to extract, 40 days from extraction to analysis 7 days to extract, 40 days from extraction to analysis
TCL Polychlorinated biphenyls (PCBs) SW-846 8082A	Soil Water	8 oz glass Two 250 mL amber glass	Cool 4 ± 2°C	14 days to extract, 40 days from extraction to analysis 7 days to extract, 40 days from extraction to analysis

(a) All soil and groundwater samples to be preserved in ice during collection and transport
(b) Days from date of sample collection.
HDPE - High Density Polyethylene
TAL - Target Analyte List
TCL - USEPA Contract Laboratory Program Target Compound List
USEPA - United States Environmental Protection Agency

FIGURES

1. Proposed Remedial Investigation Sample Locations

LEGEND

- LOCATION OF PROPOSED RI SOIL BORING
- LOCATION OF PROPOSED RI SOIL BORING AND PERMANENT MONITORING WELL
- LOCATION OF PROPOSED RI SOIL BORING AND TEMPORARY SOIL VAPOR POINT
- LOCATION OF PROPOSED RI SOIL BORING, PERMANENT MONITORING WELL, AND TEMPORARY SOIL VAPOR POINT
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES MONITORING WELL COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL BORING COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL BORING AND GROUNDWATER SAMPLE COLLECTED IN 2020
- LOCATION OF GALLAGHER BASSET TECHNICAL SERVICES SOIL VAPOR POINT COLLECTED IN 2020
- LOCATION OF ROUX SOIL BORING
- ANTICIPATED GROUNDWATER FLOW DIRECTION
- BCP SITE BOUNDARY

NOTE

1. PROPOSED SAMPLE LOCATIONS ARE APPROXIMATE AND SUBJECT TO CHANGE

AOC - AREA OF CONCERN
BCP - BROWNFIELD CLEANUP PROGRAM
NYSDEC - NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION
RI - REMEDIAL INVESTIGATION

30 0 30'

Title:

PROPOSED REMEDIAL INVESTIGATION SAMPLE LOCATIONS

BROADWAY TRIANGLE SITE C
59-69 BARTLETT ST, 84-100 THROOP AVE
AND 90-100 GERRY ST, BROOKLYN NY

Prepared for:

UNIFIED NEIGHBORHOOD PARTNERS LLC

ROUX

Compiled by: B.V.	Date: 07/28/21	FIGURE
Prepared by: M.S.R.	Scale: AS SHOWN	1
Project Mgr: B.V.	Project: 3605.0001Y003	
File: 3605.0001Y114.1.mxd		

V:\GIS\PROJECTS\3605\0001Y\114\3605.0001Y114.1.MXD

ATTACHMENTS

1. Professional Profiles
2. NYSDEC January 2021 PFAS Guidance
3. Laboratory Standard Operating Procedures and Certifications
4. Roux Standard Operating Procedures
5. Laboratory Chains of Custody

ATTACHMENT 1

Professional Profiles

ROUX

PROFESSIONAL PROFILE

Jessica L. Taylor, P.G.
Principal Hydrogeologist

TECHNICAL SPECIALTIES

Project Management and Field Management for large-scale soil excavation and remediation projects, including site assessment, remediation implementation, and construction activities. Negotiation with NYSDEC Brownfield Cleanup Program (BCP) and NYCOER E-Designation/Voluntary Cleanup Program. Coordination and management of large-scale demolition and renovation support. Performance of sampling and direction of field sampling teams for the following media: soil, groundwater, surface water, soil vapor, sludge, and sediment. Excavation sampling and oversight and waste tracking.

EXPERIENCE SUMMARY

Fifteen years of experience: Principal, Senior, Project, and Staff Hydrogeologist, Roux Environmental Engineering and Geology, D.P.C., Islandia, New York; Staff Hydrogeologist and Intern at GSC|Kleinfelder.

CREDENTIALS

B.S. Geology, Binghamton University, 2005
Professional Geologist, New York, 2017
OSHA 40-Hour HAZWOPER Training, 2005
OSHA 10-Hour Construction Safety Training, 2008

KEY PROJECTS

- Project Principal for a large on-going redevelopment project in Brooklyn, New York, including four buildings with E-Designations. The project encompasses 22 acres including the Barclays Center. Project includes coordination and oversight of *in situ* waste characterization sampling, excavation, and proper disposal of soil. Coordination of pre-demolition asbestos and hazardous materials surveys. Construction management and support for excavation of 500,000 CY of soil; environmental support for demolition and relocating of an active nine-acre 100-year old rail yard. Responsible for implementing and managing remediation work at several NYSDEC spill sites within the project footprint, including *in situ* chemical oxidation, UST removal, and soil excavation. Agency support for NYSDEC, NYCDEP, NYCOER, MTA (LIRR/NYCT), and ESDC.
- Project Principal for remediation of two parcels in Queens, New York as part of NYSDEC Brownfield Cleanup Program. This project included due-diligence environmental assessment and investigation, development of NYSDEC-approved Remedial Investigation Work Plan and Remedial Action Work Plan, and remediation during construction of two mixed-use, affordable housing developments. Also required coordination with NYCHPD and NYCDEP to meet regulatory requirements for funding.
- Project Principal for remediation of a 0.66-acre parcel in Brooklyn, New York as part of NYSDEC Brownfield Cleanup Program. This project included due-diligence environmental assessment and investigation, development of NYSDEC-approved RIWP and RAWP including an active sub-slab depressurization system, and remediation during construction of a mixed-use affordable housing developments including full cellar. Also required coordination with NYCHPD and NYCDEP to meet regulatory requirements for funding.
- Project Principal for management of E-Designation during excavation and construction of a hotel/residential building in Manhattanville, including management of waste characterization and disposal of 16,000 CY of soil.
- Project Principal for redevelopment of four properties in Brooklyn, with NYCOER to address NYCDEP E-Designations. Coordination with NYCOER to implement remedial investigation and develop RAP as part of the NYC VCP.
- Senior Project Manager for the environmental management of asbestos remediation during the renovation of Nassau Coliseum, Uniondale, New York. Responsible for coordinating inspections and delineation of ACM, preparing budgetary estimates, and bid support for full abatement. Also includes management of decommissioning and replacement of existing emergency generator UST.
- Project Manager for commercial redevelopment site in the Bronx, including *in situ* waste characterization, management and coordination of excavation, community air monitoring, and development of NYCDEP-approved RAP.
- Client liaison and full-time onsite construction manager at redevelopment site in Rego Park, New York. Collection of 500 *in situ* waste characterization soil samples, oversight of 250,000 cubic yards of soil excavation and remediation, development of post-remediation sampling plan, organization of waste manifests and hazardous waste documents to ensure proper disposal. Coordination of daily site activities with multiple construction contractors and other involved parties on behalf of client. Oversight and confirmatory soil sampling for on-site treatment of 75,000 cubic yards of hazardous lead contaminated soil.
- Project and Field Manager for multiple Phase I and Phase II ESAs of retail gasoline stations in New York and New Jersey. This includes drilling and sampling oversight and health and safety management, as well as writing Phase II ESA reports for over 40 sites.

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2395
E-mail: jtaylor@rouxinc.com | Website: http://www.rouxinc.com

ROUX

PROFESSIONAL PROFILE

Charles J. McGuckin, P.E.

Principal Engineer

TECHNICAL SPECIALTIES

Engineering design of soil and groundwater remediation systems. brownfields cleanup plans, stormwater studies and engineered natural treatment systems.

EXPERIENCE SUMMARY

Thirty years of experience: Principal, Senior and Project Engineer with Roux Associates; President of Remedial Engineering, P.C.; and Design Engineer at Dvirka and Bartilucci Consulting Engineers.

CREDENTIALS

B.C.E., Civil Engineering, University of Delaware, 1987
M.B.A., Management, Adelphi University, 1992
Professional Engineer: New York, New Jersey, Pennsylvania, Rhode Island, Connecticut, Vermont, Virginia, North Carolina, Ohio, Michigan and Montana

PROFESSIONAL AFFILIATIONS

National Society of Professional Engineers
American Society of Civil Engineers
WEF Hazardous Waste Committee, 1996 – 1998

PUBLICATIONS

Assessment and Remediation of Off-Spec Asphalt Disposal Areas - Co-authored, Contaminated Soils, Volume 3, Amherst Scientist Publishers, 1998

Use of a Subsurface Flow Constructed Wetlands for Collection and Removal of Water Containing BTEX, Co-authored, Proceedings of the 2000 Petroleum Hydrocarbons and Organic Chemicals in Groundwater Conference, National Ground Water Association

KEY PROJECTS

- Principal Engineer for environmental consulting support services for a large landfill O&M contract under review by the New York City Department of Investigation. The work entailed reviewing the scope of routine vs. non-routine work performed over a one-year period for compliance with contract requirements. The O&M Work included routine cover maintenance, groundwater and gas monitoring, landfill gas extraction, major system repairs and waste handling. Memos of findings were prepared assessing acceptability of work, compliance with permit regulations and providing recommendations for improvements.
- Principal Engineer for the independent engineering review of change orders for the New York MTA Office of the Inspector General associated with electric utility substations reconstruction damaged during the 2012 Superstorm Sandy. The cost review focused on contracting procedures, waste classification of impacted structures and soils, proper waste management and disposal. Findings were compiled in a report to determine if costs were legitimate and justifiable and providing recommendations for improved specifications for bidding and of management waste handling contracts.
- Principal Engineer providing program management of interior building materials surveys for 22 residential buildings along the south shore of long island under an Army Corps of Engineers contract for dune reconstruction. Building materials surveys included testing and analysis of suspect contaminants and reporting in support of building abatement and demolition planning. Testing was completed using multiple teams on a tight timeline to meet project schedule requirements.
- Principal Engineer for remedial action plan implementation oversight and certification for the CornellTech campus development on Roosevelt Island, New York. The first phase of the campus development included lead paint and ACM abatement and demolition of the former Goldwater Hospital, construction of six main campus buildings, new utilities, roadways and lawn/landscaped areas. Responsibilities include oversight of soil/subsurface structures excavation handling, disposal and reuse; community air monitoring; dewatering permit compliance; and SWPPP inspections.
- Principal Engineer for the preparation of an expert report for a former valve manufacturing facility in Coxsackie, New York. The report was prepared on behalf of counsel for a Contractor who performed remedial construction work for this State "Superfund" site. The actions were against the holder of the construction contract, NYSDEC, and their engineering consultant. The remedial action included building demolition, remediation of soils impacted by chlorinated VOCs, removal of DNAPL source areas, treatment of excavated soils using low temperature thermal desorption, and consolidation and capping of metals impacted soils. The expert project work involved a detailed review of the RI/FS, remedial action plans and construction progress documentation to formulate opinions as to the industry acceptable accuracy of the Contract Documents.
- Senior Engineer for the decommissioning and decontamination of a pharmaceutical facility covering seven city blocks as a part of a NYSDEC Voluntary Cleanup Agreement in Brooklyn, New York. The former office and laboratory complex would be decontaminated for reuse as a school and small business space. Multiple other buildings were demolished. Responsibilities included preparation of interior abatement plans to address mercury, lead and PCBs in building materials and review of Interim Remedial Measure (IRM) work plans for lead, benzene and mercury-contaminated soil excavation and disposal. Groundwater remediation design included air sparge/soil vapor extraction, in situ oxidation and a reactive barrier wall using colloidal carbon and ZVI.
- Principal Engineer for the performance of a Brownfields Demonstration Pilot Program in the Hamlet of New Cassel for the Town of North Hempstead, New York. Under an EPA grant, Roux Associates created an inventory of 50 potential commercial/industrial properties within New Cassel and evaluated these properties based on perceived contamination and potential for redevelopment/reuse. Eight sites exhibiting the greatest potential for redevelopment were selected to perform Phase I

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2346
E-mail: cmcguckin@rouxinc.com | Website: www.rouxinc.com

Charles J. McGuckin, P.E.
Principal Engineer

Environmental Site Assessments. Of these eight sites, four sites were selected for Brownfield Site investigations to identify the nature and extent of contamination in soil and groundwater and provide potential remedial alternatives and cleanup costs to revitalize these properties. The Brownfields Demonstration Pilot Program also included community outreach activities to promote a unified approach to the redevelopment of Brownfields in new Cassel.

- Principal Engineer responsible for engineering certification of all remediation activities related to the seven-city-block Barclay's Arena and Atlantic Yards redevelopment in Brooklyn, New York. This multi-billion-dollar redevelopment includes the Arena, which will be focal point of the largest redevelopment project in Brooklyn, consisting of an urban complex of housing, commercial and retail space, as well as several acres of landscaped public open space. The existing properties being redeveloped are residential, commercial, and industrial properties, including a large railroad yard. Engineering certification included multiple RAWPs under NYSDEC Spills Program, UST removals, soil excavation, in situ groundwater treatment and remedy oversight services. The project also includes ACM abatement, building demolition, soil pre-waste-classification, coordination (with the receiving facilities), and oversight of the removal of 1,000,000 cubic yards of soil (~550,000 yards removed to date), representing one of the largest excavation and soil removal projects performed in New York City.
- Principal engineer for the preparation of the feasibility study, IRM plans, and remedial design/remedial action plans for a 40-acre former manufacturing facility in Rensselaer, New York. IRM Soil remediation included excavation of over 10,000 cubic yards of CVOC and metals source material for disposal at multiple facilities based on waste characteristics. Basement cleaning was performed in three large buildings to remove accumulated process sludges. Lagoon closure plans included sediment removal, dewatering, soil washing, and soil capping. The final remedy for the site includes a groundwater perimeter containment trench and 40 gpm treatment system for metals and VOCs and a 9-acre vegetated cap for a former landfill.
- Principal Engineer responsible for the preparation of the remediation completion report at Captain's Cove former municipal landfill State Superfund Site located in Glen Cove, New York. This work has been performed in accordance with Title 3 of the NYS Environmental Quality Bond Act under contract to the City of Glen Cove. Design elements included excavation plans, radiological waste monitoring, demo debris and waste separation and screening, dewatering water management, waste disposal, and site restoration. Additional work included the delisting of a six acre "clean" portion of the site to allow the development of a ferry terminal and esplanade and development of alternative cleanup standards consistent with future site uses. Site remediation will accommodate site redevelopment as a commercial waterfront and operating ferry service and seaport area.
- Principal Engineer for the feasibility studies and remedial action work plans for multiple operable units of a large railyard located in Sunnyside, Queens, New York under the NYSDEC Inactive hazardous waste program. For the former engine house and maintenance area unit, pre-design studies included product plume thickness data collection and modeling, ex situ biopiles treatment, *in situ* enhanced bioremediation, and *in situ* chemical oxidation. The final design consisted of decontamination and removal of structures, excavation of hot spot soils for PCBs and lead, UST closures, a dual phase high vacuum extraction system and *in situ* bioremediation.
- Principal Engineer for the remediation of a former Manufactured Gas Plant (MGP) facility in Brooklyn, NY, including oversight of the excavation of both the former gasholders, and adjacent contaminated hotspots requiring offsite thermal desorption of over 30,000 tons of coal tar impacted soil. Directed the Community Air Monitoring Program (CAMP) specific to the MGP impacted soil removal, as required by both New York State Department of Environmental Conservation (NYSDEC) and New York State Department of Health (NYSDOH). Remedial activity met all substantive requirements of the NYSDEC approved Remedial Action Work Plan for the Site. The remedy included design of a passive subsurface vapor monitoring/recovery system for a 500,000 sq. ft. retail structure in Brooklyn, NY. The system design integrated a perforated piping system complemented by a protective vapor barrier below the structural floor slab to monitor and mitigate volatile organic compound vapors. Multiple vapor barrier options were evaluated to determine the optimum design based on the site conditions.
- Principal Engineer providing expert settlement support services to a county municipality in New York State. The case involved an EPA Order for underground storage tank (UST) compliance for over 50 county operated facilities with over 125 USTs. The project involved the field inventory of the USTs at each facility and development of both Interim and final compliance plans to comply with EPA, NYSDEC and local UST regulations. Detailed cost estimates were prepared for multiple scenarios for upgrading USTs including tightness testing, manway repairs, leak detection and overfill protection monitoring systems, UST removal and replacement, and new piping. The upgrade evaluation and negotiations included incorporation of Supplemental Environmental Project (SEPs) in accordance with EPA requirements. SEPs included centralized monitoring systems for leak detection and inventory control.
- Principal Engineer for preparation of a site management plan for redevelopment of a former watch case factory in Sag Harbor, New York. The primary engineering controls for the former factory conversion to a residential building consisted of a vapor barrier and an active subslab depressurization

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2346
E-mail: cmcguckin@rouxinc.com | Website: www.rouxinc.com

system (SSDS) to address chlorinated VOCs. The SSDS system was complicated due to the existing 100-year-old structure. A unique raised floor approach was designed to allow for the SSDS installation. The system design, approved by NYSDEC and NYSDOH includes multiple legs, dual blowers, low vacuum alarms and monitoring points.

- Principal Engineer for the Remedial Action Work Plan (RAWP) for redevelopment of a shopping center in the Bronx, New York. The RAWP elements included soil and groundwater management plans, stormwater management, air monitoring and vapor mitigation systems. To address vapor intrusion, active subslab depressurization systems were designed for two pad buildings. One system for a new retail building construction and one retro-fit system for an existing building to be used as a restaurant. Closure reports were prepared and certified documenting all remediation work and approved by NYC Mayor's Office of Environmental Remediation (OER).
- Principal Engineer for the preparation of a preliminary remedial design for the remediation and restoration of a pond and surface water tributaries to Canaan Lake that have been impacted from leachate generated from an upgradient former municipal landfill located in Holtsville, New York. Completed a preliminary remedial design for the construction of a compost-based permeable reactive barrier for the removal and treatment of leachate prior to discharge to the surface water, followed by restoration of the surface water body and surrounding wetlands. The project included development of a long term remedial strategy to reduce rainfall infiltration into the landfill and minimize leachate generation. Current plans to reduce rainfall infiltration include the planting of 3,250 hybrid poplars, regrading and lining of drainage swales, and the resurfacing of low lying areas consistent with recreational facilities.
- Principal Engineer for final capping elements and wetlands restoration work and completion of the Final Engineering Report for an inactive hazardous waste site in Syracuse, New York. The project included onsite consolidation of lead impacted waste; 7-acre landfill cap with vegetated layer, cover soil, and geomembrane; stormwater runoff controls; reconstruction of waste water ponds; and an 8-acre wetland restoration. An O &M Plan was prepared and implemented consisting of groundwater, surface water and landfill gas monitoring, and annual cap and wetland inspections.
- Principal Engineer for the preparation of the remedial action work plan for an 11-acre former Department of Defense owned Site that manufactured airplane parts along Hempstead Harbor in Manorhaven, New York. The project is regulated under the NYSDEC Voluntary Cleanup Program. The remedial design consisted of both soil vapor extraction/air sparging and *in situ* enhanced bioremediation systems for Site groundwater impacted by chlorinated VOCs. The final remedial design and site management plan are expected to include soil capping, vapor barriers and passive ventilation systems to be incorporated into a residential redevelopment with waterfront access.
- Project Engineer for the design and construction management of a 600 gpm groundwater extraction and treatment system to prevent offsite migration at a petroleum storage and pipeline transfer facility in Providence, Rhode Island. The treatment system was designed to remove iron, BTEX, and naphthalene from the groundwater to below surface water discharge standards for the Providence River. The system processes consisted of equalization, aeration, de-aeration, flocculation, clarification, air stripping, dual media filtration, granular activated carbon adsorption (liquid and vapor phase), and sludge thickening and dewatering. The system included an outfall diffuser designed in accordance with the CORMIX computer model.
- Senior Engineer responsible for the design, construction management, and O&M of a 60,000-gpd constructed wetlands treatment system for a former manufacturing facility in Virginia. The 16-acre treatment system was designed within an existing phragmites wetland to remove zinc and iron from landfill leachate prior to discharge to an adjacent creek. The treatment system consisted of alkalinity producing cells, oxic ponds, compost and limestone berms, anaerobic cells and aerobic cells. The design included a 400-foot reinforced earthen dike together with hydraulic control structures and piping to maintain cell water levels and flow rates. The system also includes a pump station and force main for both effluent discharge and irrigation purposes. Joint wetlands and local permit approvals were obtained for the project.
- Senior Engineer for the performance of a stormwater runoff evaluation for a manufacturing facility in Watertown, New York. Roux Associates was retained as third party to evaluate the drainage design and construction elements for an industrial landfill cap. The evaluation was performed for the facility owner in support of potential litigation arising from onsite building flooding incidents following a severe snow and rain storm event. The scope of work included an evaluation of the existing onsite storm sewer system capacity, calculation of runoff flow rates for the 300-acre contributing area, review of landfill cap surface drainage design, review of erosion control measures implemented during construction, and analysis of specific flooding incident causes. The runoff analyses were performed using the TR 55 Method for three conditions: pre-capped, capping under construction prior to establishment of vegetation, and final vegetated cap design. Recommendations were made to improve the site drainage including design of surface drainage swales, temporary berms and sediment traps during construction and modification of snow handling practices.
- Senior Engineer for the performance of a feasibility study and remedial design for the closure of a concrete oil/water separator filled with refinery sludge and demolition materials impacted with lead at a former

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2346
E-mail: cmcguckin@rouxinc.com | Website: www.rouxinc.com

Charles J. McGuckin, P.E.
Principal Engineer

refinery in Providence, Rhode Island. Remedial alternatives were developed and evaluated including capping and containment using a perimeter slurry wall, sheet piling or concrete wall sealing; excavation and disposal; and *in situ* solidification. The capping and containment using a slurry wall alternative was selected for implementation of the remedial design. The design consisted of removal and replacement of existing monitoring wells, sealing of separator wall openings, a 2-acre multi-layer cap, a 1200-foot long by 30-foot deep soil-bentonite slurry wall, and a perimeter drainage swale. The multi-layer cap included a 40-mil HDPE geomembrane and a geosynthetic clay liner. The slurry wall was keyed into the existing clay confining layer beneath the separator. The design incorporated disposal of an additional 10,000 cubic yards of petroleum impacted soil under the cap.

- Principal Engineer for the preparation of field implementation plans, construction monitoring, and Engineers Certification Report for a former manufactured gas Plant (MGP) site in Manhattan, New York. The site was one of the first projects completed under the NYS Brownfields Cleanup Program. The remedy included soil excavation and offsite thermal treatment, a sheet pile barrier wall, a vapor barrier and basement ventilation system. A comprehensive air monitoring program was conducted due to the concerns over coal tar residue emissions and odors on the surrounding community. The remedy was incorporated into the design and construction of the headquarters office building of an international media company.
- Principal Engineer for the management of a soil and ground-water remediation system for a nationwide overnight delivery distribution center in Brooklyn, New York as part of the NYSDEC Voluntary Cleanup Program. A risk-based remedial approach that called for the remediation of "hot spot" source area soils, and mass-reduction of VOCs was successfully utilized for the Site. As a result, the focus of remediation was on reducing the mass of VOCs in on-site groundwater to a level where natural attenuation would be effective in remediation of VOCs. To address the contamination in the source area, a soil vapor extraction (SVE) and air sparge (AS) system consisting of 8 SVE wells and 17 AS wells was designed, constructed, operated and maintained for a period of approximately 3 years. Permanent shutdown of the system was approved by the NYSDEC.
- Senior Engineer for the design and construction management of a soil remediation and stormwater management project at a 16-acre former pesticide warehouse facility in Dayton, New Jersey. The Site was redeveloped for storage and trailer parking. The project consisted of consolidation of pesticide contaminated soils; asphalt capping of the 3.5-acre contaminated soils area; stormwater collection, conveyance and detention; and site regrading. The evaluation included TR-55 runoff modeling for pre and post capping and development conditions. The storm sewer system consisted of multiple catch basins, over 2,000 linear feet of reinforced concrete pipe ranging in size from 15 to 30 inches, and a recharge basin. A Soil Erosion and Sedimentation Control Plan and a NJPDES General Permit were prepared for the project.
- Project Principal for the performance of LNAPL remediation studies at the New Jersey Transit former Lake Street Bus Garage in Newark, New Jersey. The studies involved evaluating remedial alternatives for free product recovery, performance of an LNAPL recovery pilot test and cost estimating. A RAWP and engineering design plans were prepared for both the bus garage and the adjacent park properties. The remedy included excavation of the source area, horizontal recovery wells, a vertical recovery trench, *in situ* oxidation injections and product recovery using vacuum extraction.
- Senior Engineer for the performance of a stormwater management analysis for a 28-acre industrial landfill in Virginia. The principal objective of the study was to identify engineering controls to minimize stormwater runoff to a metals-contaminated sediment impoundment. The study included TR-55 runoff modeling and storage analyses for multiple detention ponds. Three engineering control alternatives were identified including landfill cap regrading, diversion using berms and swales, and diking and weir raising.
- Senior Engineer for the investigation, design, and construction management of the closure of a 2-acre fire-water supply pond and modification of the stormwater conveyance system at a former manufacturing facility in Williamsburg, Virginia. The investigation phase of the project was focused on determining the sources and loading of metals influent to the pond. Field activities included examination of the existing stormwater drainage system, subwatershed delineation, groundwater monitoring, and installation of automatic stormwater sampling devices. The final design included 400 feet of open concrete channels, 250 feet of culvert replacement, sliplining of 370 feet of 36-inch RCP culvert, reconstruction of five catch basins, placement of 10,000 cubic yards of clay fill within the pond and regrading of existing drainage ditches. Erosion control measures and slope stabilization were also included as well as the design of a special outlet structure for minimizing erosion at the outfall.
- Project Principal for the investigation and closure of five USTs at the New Jersey Transit Broad Street Station site in Summit, New Jersey. Tank sizes ranged from 20,000 to 30,000-gallon capacity. UST closure program completed in accordance with the NJDEP Technical Requirements for Site Remediation. Closure report prepared and submitted to the NJDEP and subsequent issuance of a No Further Action letter from the NJDEP.
- Project Engineer of the underground storage tank (UST) program for a major retail chain store in the New York, New Jersey and Pennsylvania region. Responsibilities included preparation of a UST management plan based on federal, state, and local regulations and costs to prioritize UST maintenance.

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2346
E-mail: cmcguckin@rouxinc.com | Website: www.rouxinc.com

Charles J. McGuckin, P.E.
Principal Engineer

The tank designs included plans and specifications for the removal and replacement, or upgrading, of USTs to meet regulatory requirements. The engineering design involved fuel requirements for dual heating and back-up generator usage, mechanical pumping equipment and fire wall design.

- Project Engineer for the design and construction management of a 1,000 sq. ft. hazardous and flammable materials storage facility in Syosset, New York. The facility included concrete secondary containment dikes, access ramps, sprinkler system modifications, and lighting. The separate flammable materials area included 2-hour fire rated concrete block walls and doors, ventilation equipment and a fire alarm system. Permitting services were performed for the Nassau County Department of Health, the Nassau County Fire Marshall, and the Building Department.
- Project Engineer for the design of a 2,000 sq. ft. hazardous waste storage facility in Astoria, New York. Prior to construction, demolition of an existing building was required and included removal of asbestos and lead paint. The project included driving treated timber piles and excavation and removal of contaminated soil and groundwater. The structure consisted of a steel frame with a metal standing seam roof system, decorative masonry block walls, and a roll-up door. Temporary and permanent fencing were required along with concrete sidewalk replacement.
- Senior Engineer for the decommissioning of a pharmaceutical facility covering two entire city blocks as a part of a NYSDEC Voluntary Cleanup Agreement in Brooklyn, New York. Responsibilities include technical review of Interim Remedial Measure (IRM) work plans for lead and mercury-contaminated soil excavation and disposal, implementation of these work plans (excavation and offsite disposal), preparation of biddable plans and specifications, review of IRM Closure Reports, and obtaining closure documentation from regulators on a fast track basis to allow redevelopment for a large-scale shopping complex and public schools.
- Senior Engineer providing construction management services in support of the BNYCP Cogeneration Facility construction and Brooklyn Navy Yard facility decommissioning. Work included preparation of construction management plans, supervision of soil, concrete, and sediment disposal activities, asbestos surveys, and PCB sampling and analysis work. A NYCDEP wastewater discharge permit was prepared for the million gallon per day stream condensate and wastewater backwash flow rate.
- Project Principal for performing remedial alternative cost estimating for a New Jersey Transit site in Montclair, New Jersey, which is to be redeveloped as a firehouse. A cost estimate prepared by another consultant was reviewed as part of the scope of work. The proposed remedial alternative for the site consisted of excavation and disposal of PAH-impacted fill material and capping. The alternative remedy proposed by Roux Associates was a more risk-based approach, resulting in a cost savings of approximately $100,000 for New Jersey Transit.
- Project Engineer for the design and construction management of cap repair and drainage improvement measures for an industrial hazardous waste landfill in Tennessee. Components of the design included replacement of the primary clay cover material, temporary and permanent erosion and sedimentation control measures, and a lined drainage channel to minimize the generation of landfill leachate. The project included the performance of a focused feasibility study to characterize the flow, quality, and treatability of the leachate. A feasibility study was also performed in order to evaluate constructed wetlands remedial technology as a method of effective and economical treatment of leachate.
- Senior Engineer for the remedial design and construction management of a 7-acre off-spec asphalt waste pond at a former refinery in New England. The asphalt material exhibited a low load bearing capacity combined with a viscous, tacky surface. An *in situ* solidification mix design was developed consisting of liquification using hot water and a 2-stage lime kiln dust reagent injection and mixing step. Gravel was added to the mix when the existing subgrade material was of insufficient bearing capacity. Solidified material was tested for unconfined compressive strength, durability, and TCLP. The final cover material consisted of a 6-inch vegetated layer.
- Principal Engineer for the performance of LNAPL remediation studies for a former bus maintenance facility and a segment of a Metropolitan Subway System in Newark, New Jersey. The studies involved evaluating groundwater and soil monitoring data, performance of LNAPL recovery pilot tests, evaluation of remedial alternatives and cost estimating. Recommendations included the use of mobile high vacuum extraction methods to collect LNAPL while minimizing capital expenditures and permanent low vacuum extraction methods to minimize odors to subway cars and surrounding communities.

Litigation Support Experience

- Project Engineer for the evaluation of remedial investigations and remedial cost estimates for a 30-acre former book publishing facility in Poughkeepsie, New York. The evaluation included the review of Phase I and Phase II investigation reports, remedial investigation (RI) and feasibility study (FS) reports, and the remedial investigation work plan. The findings included the presence of chlorinated volatile organic compounds in the soil and groundwater as well as identification of underground storage tanks. Deficiencies were identified in both the RI and FS reports by comparing with the NYSDEC's required criteria and recommendations were proposed for the RI work plan to further delineate source areas. Based on the remedial investigation review, revised costing assumptions were made and remedial cost estimates were prepared totaling $3.6 million.

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2346
E-mail: cmcguckin@rouxinc.com | Website: www.rouxinc.com

Charles J. McGuckin, P.E.
Principal Engineer

- Project Engineer for the evaluation of expected remedial costs for nine hazardous waste sites, two of which are federal superfund sites. The evaluation of both single and multiple PRP sites was performed to identify costs for an insurance claim. The expected remedial costs for nine sites, which include landfills or facility surface impoundments, totaled approximately $65 million. Remedial plans evaluated for multiple site operable units included groundwater pump and treat, alternative water supply systems, soil/sludge *in situ* solidification and treatment, and wetlands restoration. Additional work included evaluating invoices for site work previously performed and allocating expenses into their appropriate operable unit and work type, i.e., defense or indemnity.

Water Treatment Experience

- Senior Engineer for the engineering design of a 10 gpm groundwater recovery and treatment system at a former tank farm in Rhode Island. The recovery system included a 200-foot slotted HDPE horizontal well, a 400-foot coated concrete swale and curbing, and a series of seepage collection points manifolded to a common receiving structure. The entire system was designed for passive recovery and gravity flow transmission targeting free-product seepage areas. The treatment system consisted of a collection sump retrofitted within an existing separator, a coalescing plate oil/water separator, a surge tank, a bag filter, and carbon adsorption units. The project included a permit modification for discharge to the Providence River.
- Design Engineer for the design and start-up operation of a 2 mgd packed tower aeration system for potable water in Williston Park, New York. The primary contaminants were trichloroethane and tetrachloroethene which were stripped below drinking water standards. The design process included full scale pilot testing to assure proper removal levels.
- Design Engineer for the design, construction and start-up operation of a 5 mgd industrial cooling water treatment system utilizing mechanical surface aeration. The system consisted of two lined aeration basins operating in series with floating mechanical aerators to remove volatile organic contaminants to levels suitable for recharge into the Long Island groundwater aquifer. The primary contaminants were 1,1-dichloroethene, trichloroethane, tetrachloroethene and vinyl chloride.
- Design Engineer for the design and construction of a 4 mgd granular activated carbon system for potable water in Hempstead, New York. The primary contaminants consisted of more than 8 volatile and semivolatile organic compounds. Responsibilities included site inspection for the installation of the six vessels containing 20,000 lbs. of carbon in each. The system was designed for 99.9% removal efficiency with two units operating in series.

Constructed Wetlands Experience

- Senior engineer for the conceptual design of a constructed wetlands stormwater treatment system for a coal handling freight railroad facility in Norfolk, Virginia. The design consists of treatment of contaminated stormwater runoff generated from maintenance and fuel handling areas onsite. The design treatment performance objective is the reduction of total suspended solids, oil and grease, and selected metals to levels below the SPDES permit discharge standards established for two of the site's outfalls discharging to the Elizabeth River. The 3-acre system consists of a passively operated 200,000-gpd subsurface-type constructed wetlands with a low visual impact and specialized structural design to meet the needs of a busy railyard facility. Additional design components include stormwater bypass structures, jacking beneath tracks, a grit chamber, a lift station, and outfall modifications. A joint wetlands permit will be prepared for the project.
- Senior Engineer for the feasibility study, conceptual design and construction of four constructed wetlands units and sedimentation basin for a stormwater treatment system along Cedar Swamp Creek for the City of Glen Cove, New York. The project consisted of review of stormwater studies of the 12 square mile contributing watershed, compilation of USGS water quality and flow data, evaluation of stormwater treatment methods and best management practices and optimum site selection along the creek. The constructed wetlands design included a forebay, high and low marsh cells, a micropool, and stormwater bypass structures for removal of sediment, nitrogen, phosphorus, and trace metals during first flush events. Final design for the first 1.8 acre constructed wetlands unit was completed and performance of construction management is ongoing. Design activities include structural and hydraulic design tasks with specific emphasis on storm water bypass. The design has been integrated into an into an intermodal transportation project with the addition of bicycle and walking paths. NYSDEC and Army Corps permits were obtained for the project.
- Project Engineer for the design of a 7,000 gpd subsurface flow-type constructed wetlands treatment system for a refinery site in Rhode Island. The system was designed to treat a surface-water stream impacted by petroleum hydrocarbons. The system's high aesthetic, low visual impact appeal was ideal for its golf course setting. Both phragmites SPP and Typha SPP wetland species were incorporated in the design in order to assess the biodegradation/biotransformation processes effectiveness. A growth and maturation plan and a treatment evaluation plan were developed in order to evaluate the system performance.
- Lead Engineer responsible for technical review of a design for modifications to a constructed wetlands system in Nicholas County, West Virginia. The system was designed to treat the leachate from a solid waste landfill at a maximum capacity of 30 gpm. The complete water tight treatment system consisted of a sedimentation basin, stabilization basin, a series of three wetland cells and a finishing ditch. The wetland cells consisted of a double liner system with leachate collection piping overlaid with stone fill and a matrix of plant life. The technology combines physical,

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2346
E-mail: cmcguckin@rouxinc.com | Website: www.rouxinc.com

Charles J. McGuckin, P.E.
Principal Engineer

geochemical and biological removal mechanisms operating simultaneously.

Permitting/Compliance Plans

- Project Engineer for the preparation of a Spill Prevention Control and Countermeasure (SPCC) Plan and a Storm Water Pollution Prevention Plan (SWPPP) for an 850-acre petroleum storage terminal in New England. The SPCC Plan involved the inventory of 50 bulk storage tanks and miscellaneous storage vessels and an assessment of barge loading areas, truck loading racks, additive loading areas, pumping stations, and a network of aboveground pipelines. The SWPPP encompassed an inventory and surveying of the existing storm sewer system, an evaluation of oil/water separator performance and identification of storm water management controls and practices.
- Project Engineer for the design of modifications to multiple discharge facilities along the Providence and Runnins Rivers in Rhode Island. Permitting activities were performed with the following agencies: Rhode Island Department of Environmental Management (RIDEM) Pollutant Discharge Elimination System (RPDES), RIDEM Division of Freshwater Wetlands, Coastal Resources Management Council (CRMC), and the Army Corps of Engineers.

Sanitary Experience

- Design Engineer for the evaluation of a municipal sanitary sewer system consisting of approximately 70 miles of piping ranging in size from 8 inches to 16 inches, in Garden City, New York. The sewer system was evaluated for existing and proposed flow capacity, surcharging, infiltration of groundwater, inflow of storm water, root encroachment, and sewer breaks. Evaluation methods consisted of hydraulic profile analysis, television inspection of piping, field inspection of manholes, and flow measurement. Sewer upgrading methods were evaluated including direct replacement, manhole restoration and pipe slip lining, and a rehabilitation program was implemented.
- Design Engineer for the City of Glen Cove's industrial wastewater pretreatment program which was established to monitor significant industrial users discharging to the city's wastewater treatment plant to minimize upsets to the biological treatment mechanisms. The program work included annual facility inspections, wastewater discharge sampling, review and evaluation of quarterly self-monitoring results, calculation of discharge penalty fees, preparation of annual monitoring reports for each facility and development of wastewater discharge permits to comply with City regulations.
- Design Engineer for a heavy metals study for the municipal sanitary sewer system in the City of Glen Cove, New York. The heavy metals study consisted of the development and performance of a city-wide sewer sampling program to identify the sources of heavy metals loadings on the wastewater treatment plant. The evaluation included industrial sources, scavengers, non-industrial sources, the plant operation itself, and review of existing heavy metal studies. Recommendations were provided for minimization of loadings and pretreatment to protect the plant operations.

Stormwater Experience

- Design Engineer for the evaluation and conceptual design of a water management plan for a 200-acre proposed office complex in Bethpage, New York. The design included inlets, piping and recharge basin sizing for peak storm water runoff flows as well as a system of architectural ponds and level control structures. For dry periods, the design included flow controls connected to an existing cooling water system to maintain pond levels and for utilization as a water supply for an irrigation sprinkler system during the growing season.
- Design Engineer for the design of a municipal storm drainage system for a 200-acre contributing area in Garden City, New York. The purpose of the drainage system was to alleviate severe flooding problems for eight homes located in a local low point of a residential neighborhood. The system included over 4,800 linear feet of reinforced concrete piping ranging in size from 12 to 60 inches. Design considerations included hydraulic gradient analysis, inlet capacity, utility crossings, minimization of removals of established trees, a county road crossing, utilization of existing structures and piping, and a headwall discharge to a recharge basin. Additional design items included pavement restoration, service line relocations, curbs and sidewalks, and maintenance and protection of traffic.

Site Assessment Experience

- Senior Engineer for coordination and review of Phase I environmental site assessments for five large research and development complexes located throughout the eastern United States for a major chemical company. The site assessments were performed for due diligence prior to engaging in long-term property lease agreements. The site assessments evaluated chemical storage and handling areas and previous site usage.
- Senior Engineer for coordination and review of Phase I environmental site assessments for 12 properties associated with tennis centers acquisition on Long Island, New York. The properties were either active tennis center facilities or vacant parcels available for new construction. All site assessments were conducted in accordance with ASTM standards for commercial real estate transactions. Primary concerns identified were USTs, drum storage areas, and unauthorized dumping.
- Project Manager representing a group of banks investing in a 20-acre commercial property in Westchester, New York. The onsite soil was contaminated with several volatile and semivolatile organics. Performed an evaluation of the remediation plan which included onsite biological treatment of soils and aeration and oil water separation of groundwater.

Water Main Experience

- Project Engineer for the design of over 6,000 feet of ductile iron water main in sizes from 4 to 16 inches for Town of Hempstead, New York Department of Water

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2346
E-mail: cmcguckin@rouxinc.com | Website: www.rouxinc.com

Charles J. McGuckin, P.E.
Principal Engineer

and the Nassau County, New York Department of Public Works. The designs included wet and dry connections to existing mains, fittings, valves, copper services and fire hydrants. Restoration work included replacement of asphalt pavement, concrete sidewalk and curbs, and grass areas.

- Design Engineer for the design and construction management of over 10,000 feet of ductile iron water main in sizes from 6 to 12 inches for the Town of Wallkill, New York. The designs included booster pump station upgrades, a stream crossing, a wetlands crossing, jacking of 36-inch casing beneath a state highway, air release chambers, copper service re-connections, fire hydrants, valves and appurtenances. Restoration work included wetlands restoration, backfilling and regrading within a NYSDOT right-of-way and grass and pavement replacement.
- Design Engineer for the design and construction management of upgrades to a 3.7 mgd potable water booster pump station for the Town of Wallkill, New York. The design featured the replacement of a hydropneumatic tank and pump system with three larger capacity centrifugal pumps. The upgrades were performed while maintaining the pump station service. The pump station revisions included piping, pump pads, shut-off valves, silent check valves, pressure relief valves, gauges, ventilation equipment and a motor control center.

Feasibility Study Experience

- Senior Engineer for the performance of a feasibility study and remedial design of a free product containment and recovery system at a former refinery in New England. The areal extent of the free-product plume was approximately 10 acres with a measured thickness of up to eight feet. Pilot testing activities consisted of pump tests, baildown tests, and funnel and gate systems with and without sheeting. The selected remedial alternative consisted of re-routing and repair of active storm sewer piping, closure-in place of a former 72-inch storm drain using clay fill material to form a barrier wall, and installation of multiple recovery trenches totaling 450 linear feet. The recovery trenches were installed to a depth of 14 feet using a deep trenching machine and were completed with gravel, horizontal perforated piping, recovery wells, and monitoring wells to accommodate both passive and active product recovery pumping equipment. Product recovery enhancement pilot testing was also performed by using non-ionic surfactants, mechanical re-working of soil and vacuum extraction methods.
- Project Engineer for the performance of a feasibility study for the containment of a free-product plume beneath a refinery site in Rhode Island. The feasibility study included analysis of groundwater modeling, bench and pilot scale treatability studies, groundwater quality characterization, identification and screening of discharge alternatives, and treatment process evaluations. The work also included the evaluation of the discharge of treatment system effluent to several receptors including groundwater, wetlands, sanitary sewers, and storm sewers. Discharge requirements were evaluated for process water, off-gas air and residual wastes. Several treatment processes were also evaluated including metals precipitation and sludge dewatering, VOC and SVOC removal, and off-gas treatment. Preferred alternatives for each process were selected for remedial design development.
- Project Engineer for the performance of a feasibility study for a hazardous waste landfill located at a Superfund site in Tennessee. The feasibility study focused on the characterization and quantification of landfill leachate consisting of chlorinated organic compounds as well as proprietary pesticide compounds. The remedial technologies which were evaluated included leachate collection alternatives, onsite treatment alternatives and offsite disposal methods. An analysis was performed for onsite treatment technologies which included constructed wetlands, biological fluidized bed reactor, and granular activated carbon adsorption. The technologies were assembled into four feasible remedial alternatives and treatability studies were recommended to confirm the suitability of selected processes.

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2346
E-mail: cmcguckin@rouxinc.com | Website: www.rouxinc.com

ROUX

PROFESSIONAL PROFILE

Brandon D. Vella

Project Scientist

TECHNICAL EXPERIENCE

Phase I and Phase II Environmental Site Assessments (ESAs) conducted in accordance with American Society for Testing and Materials International (ASTM) E1527-13, E2600-15, and E1903-11; management and closure of New York State Department of Environmental Conservation (NYSDEC) spill sites; underground storage tank (UST) investigations and closure; Exposure Assessments (EAs) and Spill Closure Requests; conceptual site model (CSM) development; Environmental Quality Information Systems (EQuIS) database management; Mann-Kendall statistical trend analysis; constituent of concern (COC) migration modeling using Groundwater Spatiotemporal Data Analysis Tool (GWSDAT); investigation and remediation of underground injection control (UIC) structures including stormwater systems, sanitary systems, and grease traps; New York State Pollutant Discharge Elimination System (SPDES) monitoring and Stormwater Pollution Prevention Plan (SWPPP) compliance; installation of soil borings and groundwater monitoring wells; soil vapor intrusion (SVI) investigations; remedial construction oversight; regulatory coordination; development of site-specific health and safety plans (HASPs); Request for Proposal (RFP) development; subcontractor bid evaluation; management of subcontractors and third-party personnel.

EXPERIENCE SUMMARY

Over one year of experience: Project Scientist at Roux Environmental Engineering and Geology, D.P.C., Islandia, New York

Two and a half years of experience: Associate Environmental Scientist and Case Manager at Groundwater & Environmental Services, Inc., Hauppauge, New York

One and a half years of experience: Environmental Scientist at Enviroscience Consultants, Inc., Ronkonkoma, New York

CREDENTIALS

B.S. Biochemistry & Minor Environmental Studies, SUNY Binghamton 2014

OSHA 40-Hour HAZWOPER and 8-Hour Annual Refreshers

OSHA 30-Hour Construction Safety

OSHA Site Supervisor

RCRA and DOT Hazardous Materials Transport

Loss Prevention System (LPS) Manager and Supervisor

ExxonMobil Permit Issuer and Recipient

American Red Cross First Aid and CPR

Smith Safe Driver Trained

PUBLICATIONS

Vella, B.D. & Schertzer, J.W. "Understanding and Exploting Bacterial Outer Membrane Vesicles." *Pseudomonas: Volume 7: New Aspects of Pseudomonas Biology*. Edited by J.-L. Ramos, J.B. Goldberg, & A. Filloux, Dordrecht: Springer Netherlands, 2015, pp. 217-250.

KEY PROJECTS

- Case Manager for a legacy portfolio of active retail gasoline and automotive service stations throughout Nassau, Suffolk, Westchester, and Rockland Counties in New York. The portfolio sites were associated with multiple open NYSDEC spills, numerous historic releases of petroleum product including comingled petroleum hydrocarbon volatile organic compound (VOC) plumes, and multiple historic remediation attempts. Assisted Senior Project Managers by drafting work plans, RFPs, and summary investigation reports. Coordinated and conducted field activities including management and oversight of subcontractor personnel in accordance with site-specific HASPs. Interpreted laboratory analytical data and conducted statistical trend analyses. Drafted technical figures and models such as contour maps, soil data maps, hydrographs, hydrogeologic cross-sections, and soil boring/well logs. Reviewed over three decades worth of historic soil, groundwater, and remediation data in order to refine CSMs. Authored EAs and Spill Closure Requests that were submitted to NYSDEC regulators in support of spill closure.

- Prepared between 50 and 100 Phase I ESAs for properties in the greater New York City and Long Island areas, New Jersey, Connecticut, Rhode Island, Massachusetts, and New Hampshire. These assessments ranged from small residential properties to large scale industrial, commercial, and manufacturing businesses. Responsible for maintaining report integrity and compliance with ASTM E1527-13 and E2600-15 standards. Maintained client expectations and delivered accurate results in a timely manner to satisfy tight due diligence deadlines. Provided recommendations to clients if Phase II ESA investigations were warranted. All Phase I inspections and reports were completed safely, on-time, and within the allotted budgets.

- Case Manager and Field Lead for over one year during the large-scale collection of over 2,000 soil samples from wetland creek areas and adjoining residential properties in order to delineate historic releases of cadmium and hexavalent chromium at a NYSDEC Superfund Site in West Islip, New York. Sample locations were located and logged using global positioning system (GPS) navigation. Provided project quality assurance and quality control (QA/QC) for field activities including management of multiple sampling teams each comprised of three to four samplers. Ensured that all field work adhered to the sampling specifications as directed by the NYSDEC-approved Remedial Investigation Work Plan (RIWP) and Quality Assurance Project Plan (QAPP). Routinely coordinated with both NYSDEC regulators, third-party engineering firm personnel, and residential homeowners in order to achieve sampling objectives.

- Case Manager and Field Lead for light non-aqueous phase liquid (LNAPL) delineation activities at an active retail gasoline and automotive service station in Glen Head, New York, associated with one open NYSDEC spill and multiple historic releases of petroleum product. Coordinated and provided oversight of subcontractor personnel during the advancement of numerous soil borings using sonic drilling technology. Soils were field screened via visual inspection, photoionization detector

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2345
Email: bvella@rouxinc.com | Website: www.rouxinc.com

Brandon D. Vella
Project Scientist

(PID) headspace measurements, qualitative fluorescent dye assays, and subsequent subsequently submitted for laboratory analysis of VOCs. Prepared a summary report of the investigative activities that was submitted to NYSDEC and the client. Results of the delineation investigation were used to further refine the CSM in preparation for a remedial engineering alternatives analysis.

- Case Manager and Field Lead for the investigation and remediation of numerous stormwater drywells, sanitary systems, and grease traps for a variety of clients throughout Nassau and Suffolk Counties in Long Island, New York. The impacted underground injection control (UIC) structures, septic tanks, and grease traps were located on properties ranging from small single-family residences to large commercial properties, some of which were historically associated with the use and unauthorized release of hazardous materials and petroleum products. Structures were gauged, measured, and inventoried prior to sampling. Bottom sediment, and standing liquids in some cases, were sampled in accordance with Suffolk County Department of Health Services (SCDHS) Sanitary Code Article XII. Laboratory analytical results were compared to SCDHS Action Levels in order to determine if remediation was warranted. Coordinated remediation strategies under SCDHS oversight which included the removal of liquids and sediment using vacuum trucks, solid and liquid waste disposal, endpoint sampling, and backfilling of the structures with virgin sand. Results of investigative and remediatial activities were reported to clients and SCHDS in order to document proper remediation and/or closure of the structures.
- Case Manager and Field Staff for the installation of remedial system wells at an active retail gasoline and automotive service station in Roslyn, New York. Provided field oversight of subcontractors during well installation activities utilizing sonic drilling technologies in order to upgrade an existing air sparge (AS)/soil vapor extraction (SVE) treatment system targeting residual dissolved-phase and adsorbed-phase hydrocarbons associated with an open NYSDEC petroleum hydrocarbon and methyl-*tertiary*-butyl ether (MTBE) spill.
- Field Staff during Phase I and II ESA divestment activities for a portfolio of various gasoline stations and convenience stores throughout Jefferson County in New York. Conducted site reconnaissance inspections and relayed field findings to office support staff using a mobile reporting platform in order to facilitate expedited reporting requirements. Subsequently oversaw subcontractor personnel during subsurface clearance activities in preparation for the advancement of soil borings and the installation of groundwater monitoring wells. All Phase I and Phase II divestment field activities were completed safely, on-time, and within the allotted budgets.
- Field Lead for one month during stream tributary sediment sampling activities conducted in order to delineate impacts resulting from historic releases of polychlorinated biphenyls (PCBs), VOCs, semi-volatile organic compounds (SVOCs), and heavy metals at a NYSDEC Superfund Site in Dunkirk, New York. Stringent sampling equipment decontamination protocols were adhered to throughout the entire duration of the project. Sample locations with relative measured distances between stream transects, field sketches of wetland terrain, and a comprehensive photographic log were submitted to NYSDEC engineers for review in preparation for land clearing and remedial dredging activities.
- Field Staff during emergency response operations related to a per- and polyfluoroalkyl substances (PFAS) release in New Windsor, New York. Interfaced with Senior Project Managers, airport personnel, NYSDEC regulators, third-party subcontractors, media reporters, and local residents during emergency response operations. Compiled comprehensive photographic and written daily logs over the course of one month documenting the presence and abatement of aqueous film-forming foam (AFFF) found in the on-site network of stormwater drains and off-site stream tributaries throughout the surrounding town. Directed subcontractor personnel to initiate recovery of AFFF using vacuum trucks equipped with skimmers. Monitored stream tributaries for the presence of accumulated AFFF on floating absorbent booms and directed subcontractor personnel to conduct periodic boom change-outs prior to precipitation events. Maintained an inventory of on-site subcontractor resources including the number of vacuum trucks, the number of frac tanks, and accumulated water volume/available capacity of the frac tanks.
- Field Staff for routine wastewater discharge sampling at various industrial sites operated by public transportation agencies and freight carrier corporations throughout the Greater New York City metropolitan area. Collected monthly wastewater samples and recorded influent/effluent flow rates. Conducted monthly site inspections and reported potentially hazardous conditions such as failing safety devices or security controls. Prepared and submitted routine SPDES reports to regulators in accordance with SWPPPs.
- Field Staff for site characterization and remedial excavation activities at an urban housing development in Brooklyn, New York. Delineated zone of hazardous and non-hazardous impacted soils within an area approximately equivalent to one city block. Collected and submitted subsurface soils samples for analysis of VOCs, SVOCs, metals, pesticides, herbicides, and PCBs. Developed the site-specific HASP and oversaw subcontractor personnel including those responsible for operating direct-push drilling equipment, excavators, and ground-penetrating radar.

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2345
Email: bvella@rouxinc.com | Website: www.rouxinc.com

ROUX

PROFESSIONAL PROFILE

Emily Butler
Staff Scientist

TECHNICAL SPECIALTIES
Remedial construction and soil excavation oversight, management of waste characterization and removal, environmental site assessments focusing on soil, groundwater and soil vapor investigations using multiple sampling techniques.

EXPERIENCE SUMMARY
Over three years of experience: Staff Geologist, Roux Associates, Inc., Islandia, NY; Field Technical Analyst, Schlumberger Limited, Houston, TX.

CREDENTIALS
B.A. Geology, Colgate University, 2014
B.A. Geography, Colgate University, 2014
OSHA 40-Hour HAZWOPER Training, 2016
OSHA 8-hour Refresher Training, 2017
OSHA 10-hour Construction Safety Training, 2016
LIRR Contractor Safety and Security Training, 2016
Transportation Worker Identification Credential, 2014
First Aid and CPR Certified

KEY PROJECTS
- Field manager for a remedial investigation and waste characterization program at a former mall in Flushing, New York. Responsible for soil trucking and manifesting for proper disposal of over 300,000 cubic yards of soil to multiple offsite disposal facilities, including several sites enrolled into the New York City Mayor's Office of Environmental Remediation (NYCOER) Clean Soil Bank. Daily excavation oversight included coordination with the general contractor, groundwater dewatering oversight, Community Air Monitoring Program implementation, inspection of vapor barrier and waterproofing installation and daily reporting of site activity. Project management duties consisted of staff management, daily reporting to NYCOER project manager and communication with both client and contractor.
- Field Manager for a site in the New York State Department of Environmental Conservation (NYSDEC) Spills Program in Brooklyn, New York. This project included an *in situ* chemical oxidation injection program utilizing RegenOx™ oxidant compound, which was injected into 28 injection points throughout the site. Responsibilities included: monitoring groundwater from influence from injections; subcontractor oversight; and providing health and safety oversight.
- Field manager responsible for soil excavation and waste removal oversight for development of residential buildings in Brooklyn, New York. Responsibilities included overseeing excavation, organization and proper handling of waste manifests and ensuring compliance with the Site Environmental Management Plan.
- Field manager in Brooklyn, New York in charge of providing environmental support for LIRR Railyard including hazardous materials surveys (mold, lead based paint, and PCB investigation), overseeing soil excavation, and waste removal, and the proper handling of waste manifests.
- Implemented Community Air Monitoring Programs during excavation and disposal activities at multiple locations in Brooklyn, Queens and Staten Island, New York; Norwalk, Connecticut; and Jersey City, New Jersey. Responsible for monitoring airborne dust and VOCs that are potentially generated by remedial action work activities, reviewing the collected data for exceedances of the New York State Department of Health (NYSDOH) guidelines and for signing manifests for the shipment of soil to approved facilities.
- Assisted in environmental subsurface investigation in Brooklyn, New York. Responsibilities included soil boring installation, soil classification, *in situ* waste characterization sampling, managing subcontractors and providing health and safety oversight.
- Oilfield services analyst in offshore well-site units on exploration drilling rigs for multiple clients in the Gulf of Mexico. Responsible for collecting, processing, and analyzing geological samples and using various laboratory techniques to evaluate complex data for signs of oil or gas. Additionally, operated, maintained, and monitored a real-time computer-based acquisition system that recorded drilling parameters as the first line of defense for the safety and efficiency of drilling operations.

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2432
E-mail: ebutler@rouxinc.com | Website: http://www.rouxinc.com

ROUX

PROFESSIONAL PROFILE

Levi Curnutte
Project Scientist

TECHNICAL SPECIALTIES

Design, implementation, and management of Remedial Investigations and Remedial Actions for sites in regulatory programs including New York State Brownfields Cleanup Program (BCP), New York City Office of Environmental Remediation (NYCOER) E-Designation and Voluntary Cleanup Programs, and New York State Spills Program; Management of due diligence Phase I & II Environmental Site Assessments; Management of large-scale soil excavation projects including soil waste characterization implementation and construction. Additional technical skills include waterproofing, vapor barrier, sub-slab depressurization system (SSDS) installation inspections.

EXPERIENCE SUMMARY

Six years of experience: Staff Scientist and Project Scientist, Roux Environmental Engineering and Geology, D.P.C., Islandia, New York.

CREDENTIALS

B.S. Marine Science, Coastal Carolina University, 2011
M.S. Environmental Studies, College of Charleston, 2013
OSHA 40-hour HAZWOPER Training, 2014
OSHA 10-hour & 30-hour Construction Safety Training
OSHA 8-hour HAZWOPER Refresher Training, Certificate Current
NYCOER Gold Certified Professional
ExxonMobil Loss Prevention System-certified
MTA LIRR Roadway Worker Protection Training

PUBLICATIONS

Climate Change and Bemisia tabaci (Hemiptera: Aleyrodidae): Impacts of Temperature and Carbon Dioxide on Life History. Curnutte, L., Simmons, A. M., and S. Abd-Rabou. Ann. Ent. Soc. Amer. 107(5): 933-943. 2014.

KEY PROJECTS

- Project Manager for a large on-going redevelopment project in Brooklyn, New York, including the Barclay's Center and the relocation of a nine-acre 100-year old active rail yard. Project includes management of four buildings with NYCDEP "E" designations and the implementation of Remedial Action Work Plans, *in situ* soil characterization sampling, soil disposal, NYSDEC spill remediation at multiple sites, and Site Management Plan (SMP) O&M task implementation. Achieved an NYCOER Notice of Satisfaction for one property within the OER VCP. Agency support for NYSDEC, NYCDEP, NYCOER, MTA (LIRR/NYCT), and ESDC.
- Project Manager providing support for all soil and groundwater disturbances during development of Cornell NYCTech campus located on Roosevelt Island, New York, New York. Management tasks include Agency support for NYCDEP and NYSDEC, CAMP and SWPPP implementation, soil characterization for reuse and disposal, UST removal adhering to NYSDEC regulations, asbestos abatement coordination, and submission of a NYCDEP Remedial Closure Report. Received NYCDEP letter of completion of remedial activities for a portion of the site.
- Project Manager for remediation of two parcels in Queens, New York as part of NYSDEC BCP containing petroleum compounds and hazardous concentrations of heavy metals. This project included preparation of BCP Application submission, due-diligence environmental assessment and investigation, *in situ* waste characterization design and implementation, development of NYSDEC-approved Remedial Investigation Work Plans and Remedial Action Work Plans, and future remediation during construction of two mixed-use, affordable housing developments. Also required coordination with NYCHPD and NYCDEP to meet regulatory requirements for funding.
- Project Manager for an affordable housing redevelopment site in NYSDEC BCP in Brooklyn, New York also under NYCDEP oversight. The site was formally used by Brooklyn Water Works and an automobile repair facility and contaminants of concern are petroleum compounds in soil and chlorinated solvents in soil gas. Project management roles include BCP Application submission, due-diligence assessment and investigation activities, *in situ* waste characterization design and implementation, development of NYCDEP- and NYSDEC-approved Remedial Investigation and Remedial Action Work Plans. A conditional Track 1 Cleanup is intended for the site.
- Project Manager for former Manufactured Gas Plant (MGP) site in Gowanus neighborhood of Brooklyn, New York. Under NYSDEC regulation, O&M responsibilities include coordination of monitoring of recovery wells known to be former and current producers of coal tar (DNAPL) and DNAPL recovery and disposal and associated reporting.
- Project Manager for an 85-acre commercial site within the NYCOER Voluntary Cleanup Program (VCP) undergoing a 500K sq. ft. mall expansion. Project involved the construction of an adjacent building to the existing mall and a new above-grade parking structure. Manager for Remedial Action Work Plan implementation and production of multiple Remedial Action Reports leading to one NYCOER Notice of Satisfaction for the client to date.
- Project Manager for three sites with NYCDEP "E" designations that are part of a large 21-acre affordable redevelopment project in Brownsville neighborhood of Brooklyn, New York. All sites are under NYCOER regulation with one building enrolled in the VCP. Project management includes NYCOER enrollment, design and implementation of remedial investigations and assessments, design and implementation of Remedial Action Work Plans, *in situ* soil characterization sampling and soil removal (including hazardous soil), opening of a NYSDEC Spill and closure, and UST removal adhering to NYSDEC regulations.

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2371
E-mail: lcurnutte@rouxinc.com | Website: http://www.rouxinc.com

Levi Curnutte
Project Scientist

- Project Manager for on-going SMP O&M tasks and Field Manager for RAWP implementation at a NYSDEC BCP site in the Williamsburg neighborhood of Brooklyn, New York, completing extensive remediation of chlorinated VOC-impacted soil and groundwater to accommodate development of a mix-used building and underground parking garage. Primary contaminants of concern were PCE and TCE. Project responsibilities include management of zero-valent iron injections (ZVI) for a permeable reactive barrier (PRB), installation of SSDS, waterproofing/vapor barrier inspections, groundwater monitoring and sampling, CAMP, coordination and tracking of hazardous and non-hazardous waste, and providing contractor work zone health and safety recommendations/oversight in accordance with OSHA guidance. Key contributor in the submissions of the Periodic, Annual, and Final Engineering Reports submitted to NYSDEC leading to Certificate of Completion. Project received by the NYC Brownfield Partnership's 2017 Big Apple Brownfield Award for Innovation.
- Project Manager for remedial investigation of a previously abandoned oil-water separator located at a NYSDEC-regulated 175-acre former petroleum refinery and terminal in Brooklyn, New York to delineate residual contamination. Responsibilities included the management of all field tasks, site management, property owner and tenant coordination, and investigation report.
- Project Manager for on-going SMP O&M tasks and Field Manager for RAWP implementation at a NYSDEC BCP site in the Brownsville neighborhood of Brooklyn, New York. Previous use as a dry cleaner left residual contamination of PCE and TCE in soil and groundwater. Field management of remediation of chlorinated VOC-impacted soil and groundwater including source excavation and tracking of hazardous and non-hazardous waste, potassium permanganate (KMnO4) injections for groundwater treatment, installation of soil vapor extraction wells, groundwater monitoring and sampling, and CAMP.
- Field Manager of subset of field operations for a large-scale, high profile investigation of 500 residential and sensitive-use properties located throughout Los Angeles County. As a result of lengthy aerial depositions of emissions originating from a former battery recycling facility in Vernon, California, soil was analyzed *in situ* for lead contamination on a real-time basis through the use of X-ray fluorescence (XRF) instruments. Helped coordinate and perform the rapid assessment of soils by multiple teams while under heavy scrutiny by the press, regulators, and home owners.

209 Shafter Street | Islandia, NY 11749
Main: (631) 232-2600 | Direct: (631) 630-2371
E-mail: lcurnutte@rouxinc.com | Website: http://www.rouxinc.com

eurofins | Environment Testing TestAmerica

Personnel Resume

Melissa Haas
Senior Project Manager

Qualifications Summary

Ms. Haas began her career in the environmental laboratory industry in 1997. Her experience includes project management, inorganic chemistry department management, LIMS implementation, human resources and data reporting. She has a proven ability to handle multiple projects and tasks and a passion for the highest achievable level of quality and customer services.

Professional Experience

Project Manager – Eurofins TestAmerica – 2012 to Present

Ms. Haas coordinates and manages clients' projects through all phases of the laboratory operations, ensuring fulfillment of TestAmerica's commitments to client requirements and on-time delivery. She maintains communications with clients and account executives and serves as a liaison between clients and laboratory operations to meet clients' needs. She reviews contractual documents and Quality Assurance Project Plans (QAPPs) to ensure certification and laboratory analytical requirements. Ms. Haas assists clients in identifying project requirements and manages project setup on behalf of the laboratory. She also develops business relationships with clients to further enhance client service and sales. She ensures accuracy and on-time delivery of client reports.

Laboratory Information Management (LIMS) Implementer – 2011 to 2012

Inorganic Operations Manager – 2010 to 2011

Human Resources Coordinator – 2007 to 2010

Reporting Analyst – Inorganic Chemistry – 2005 to 2010

Department Manager – Classical Chemistry – 2001 to 2005

Classical Chemistry Laboratory Analyst/Data Manager – 1997 to 2001

Veterinary Technician – Mobile Veterinary Clinic, Trumbull, CT – 1994 to 1997

Campus Organizer – NJ Public Interest Research Group – 1990 to 1993

Education

- BS in Biology – Rutgers University – New Brunswick, NJ – 1990

ROUX

PROFESSIONAL PROFILE

Josh Cope
Senior Scientist

TECHNICAL SPECIALTIES
Fuel oil forensics and age dating, USEPA Superfund, OPA, and NJDEP environmental regulations, Site Assessment and Contractor Oversight, GC/MS Operator, Data Validation, Technical Report preparation and review, Field Chemistry: field screening, HAZCATTING, groundwater and soil sampling, Hazardous Waste Transportation and Disposal

EXPERIENCE SUMMARY
Over 27 years of experience; Senior Scientist with Roux Associates, Inc.; Senior Chemist, Project Manager with Tetra Tech, Inc.; Owner of Geodyne Engineering Consultants, Inc.; Quality Assurance Officer, GC/MS Operator, Twenty First Century Environmental, Inc.; Project Manager, Field Technician, Resource Applications, Inc.

CREDENTIALS
B.A., 1991, Chemistry, Haverford College
OSHA 40-Hour Health and Safety Training
New Jersey Transit (NJT) – Roadway Worker / On Track Protection

FEDERAL PROGRAMS – CLIENT: USEPA
KEY PROJECTS
- Provide technical and project management support to USEPA Removal and Remedial Branches in Regions 2, 3, 4 on Superfund and OPA projects.
- Manage and perform phase I and II site assessments, remedial investigations, removal action oversight, prepare health and safety plans, monitor site health and safety, support USEPA enforcement actions, implementation of Facility Response Plan (FRP) program, emergency response, biowatch exercises, criminal investigation support, contractor oversight, cost tracking, documentation, daily reporting, prepare after action reports, data validation, waste management, and attend public meetings
- Sites include: UST, AST, and pipeline leaks, lead smelter sites, wood treatment facilities, coal to gas plants, dry cleaners, junk yards, federal facilities, unpermitted landfills, drum burial, flood and hurricane clean up, oil refinery inspections, farmland, and historic industrial sites.
- Contaminants include: TCE, PCE, MTBE, BTEX, oil, gasoline, PCP, PAHs, mercury, lead, arsenic, ammonia, acids, bases, pesticides, PCBs, asbestos, and unknowns.
- Participated in the largest USEPA sponsored interagency response emergency response exercise, Liberty Radex, in Philadelphia. Acted as planner prior to the exercise and master controller during the exercise.
- Interface with state and local regulators on sites in Pennsylvania, Delaware, New Jersey, Maryland, Virginia, West Virginia, and Mississippi.

STATE PROGRAMS – CLIENTS: BUSINESSES AND INDIVIDUALS IN NEW JERSEY
- Provide a wide array of environmental services to homeowners, land developers, insurance companies, gas stations, and small industrial companies in New Jersey.
- Manage and/or perform ISRA reporting, phase I and II site assessments, third party investigations, subsurface evaluation, UST removal, air emissions permitting preparation, soil, groundwater, and vapor intrusion investigations, NPDES compliance.
- Manage remedial investigation, design, and execution for LUSTs, and farmland development.
- Manage reporting, deed restriction preparation, CEAs, remedial action permits, and response action outcome preparation (RAO).
- Evaluate environmental costs for insurance claims and litigation cases.
- Prepare and present justification for fine reduction to state regulators for private client.
- Meet with clients, prepare proposals, and negotiate contracts.

DATA VALIDATION/LABORATORY EXPERIENCE
- Perform level 3 and 4 data validation of analytical data packages in accordance with USEPA National Functional Guidelines.
- Data validation in accordance with NJDEP DKQP and NYS DUSR guidance.
- Quality assurance officer and GC/MS operator for New Jersey certified laboratory.
- Performed analysis of volatile and semi-volatile organics.
- Preformed maintenance and repair of analytical instruments.
- Performed method development and troubleshooting of analytical issues.
- Set up and operated mobile laboratory for organic and inorganic analyses on Superfund site assessments.
- Performed field screening of contaminants using test kits, XRF, radiation meters, and various types of air monitoring equipment.

WASTE MANAGEMENT
- Waste Management Specialist for oil pipeline client in Michigan for largest inland oil spill in United States during August 2010 through October 2011.
- Responsible for compliance, cost tracking, cost estimation, waste tracking and reporting, oil recovery calculation and reporting, contractor oversight.

402 Heron Drive | Logan Township, NJ 08085
Main: (856) 423-8800 | Direct: (856) 832-3761
E-mail: jcope@rouxinc.com | Website: http://www.rouxinc.com

Josh Cope
Senior Scientist

- Prepared Waste Transportation and Disposal Plans and responses to regulator comments.
- Prepared waste profiles, negotiated waste removal protocols with USEPA and MDEQ to streamline process of waste handling to realize savings through greater efficiency and lowering sampling requirements.
- Located disposal facilities, negotiated disposal rates.
- Performed cost benefit analysis of various soil dewatering agents and procedures and proposed methods and protocols to client, USEPA, and MDEQ.
- Performed some oversight of removal actions along river.
- Supported submerged oil assessment of river.

402 Heron Drive | Logan Township, NJ 08085
Main: (856) 423-8800 | Direct: (856) 832-3761
E-mail: jcope@rouxinc.com | Website: http://www.rouxinc.com

ATTACHMENT 2

NYSDEC January 2021 PFAS Guidance

NEW YORK STATE OF OPPORTUNITY. Department of Environmental Conservation

SAMPLING, ANALYSIS, AND ASSESSMENT OF PER- AND POLYFLUOROALKYL SUBSTANCES (PFAS)

Under NYSDEC's Part 375 Remedial Programs

January 2021

Table of Contents

Objective 7
Applicability 7
Field Sampling Procedures 7
Analysis and Reporting 8
Routine Analysis 8
Additional Analysis 8
Data Assessment and Application to Site Cleanup 9
Water Sample Results 9
Soil Sample Results 9
Testing for Imported Soil 10

Appendix A - Quality Assurance Project Plan (QAPP) Guidelines for PFAS 11
Appendix B - Sampling Protocols for PFAS in Soils, Sediments and Solids 12
Appendix C - Sampling Protocols for PFAS in Monitoring Wells 14
Appendix D - Sampling Protocols for PFAS in Surface Water 16
Appendix E - Sampling Protocols for PFAS in Private Water Supply Wells 18
Appendix F - Sampling Protocols for PFAS in Fish 20
Appendix G – PFAS Analyte List 28
Appendix H - Laboratory Guidelines for Analysis of PFAS in Non-Potable Water and Solids 29
Appendix I - Data Review Guidelines for Analysis of PFAS in Non-Potable Water and Solids 31

ERRATA SHEET for

SAMPLING, ANALYSIS, AND ASSESSMENT OF PER- AND POLYFLUOROALKYL SUBSTANCES (PFAS) Under NYSDEC's Part 375 Remedial Programs Issued January 17, 2020

Citation and Page Number	Current Text	Corrected Text	Date
Title of Appendix I, page 32	Appendix H	Appendix I	2/25/2020
Document Cover, page 1	Guidelines for Sampling and Analysis of PFAS	Sampling, Analysis, and Assessment of Per- and Polyfluoroalkyl Substances (PFAS) Under NYSDEC's Part 375 Remedial Programs	9/15/2020
Routine Analysis, page 9	"However, laboratories analyzing environmental samples…PFOA and PFOS in drinking water by EPA Method 537, 537.1 or ISO 25101."	"However, laboratories analyzing environmental samples…PFOA and PFOS in drinking water by EPA Method 537, 537.1, ISO 25101, or Method 533."	9/15/2020
Additional Analysis, page 9, new paragraph regarding soil parameters	None	"In cases where site-specific cleanup objectives for PFOA and PFOS are to be assessed, soil parameters, such as Total Organic Carbon (EPA Method 9060), soil pH (EPA Method 9045), clay content (percent), and cation exchange capacity (EPA Method 9081), should be included in the analysis to help evaluate factors affecting the leachability of PFAS in site soils."	9/15/2020
Data Assessment and Application to Site Cleanup Page 10	Until such time as Ambient Water Quality Standards (AWQS) and Soil Cleanup Objectives (SCOs) for PFAS are published, the extent of contaminated media potentially subject to remediation should be determined on a case-by-case basis using the procedures discussed below and the criteria in DER-10. Target levels for cleanup of PFAS in other media, including biota and sediment, have not yet been established by the DEC.	Until such time as Ambient Water Quality Standards (AWQS) and Soil Cleanup Objectives (SCOs) for PFOA and PFOS are published, the extent of contaminated media potentially subject to remediation should be determined on a case-by-case basis using the procedures discussed below and the criteria in DER-10. Preliminary target levels for cleanup of PFOA and PFOS in other media, including biota and sediment, have not yet been established by the DEC.	9/15/2020

Citation and Page Number	Current Text	Corrected Text	Date
Water Sample Results Page 10	PFAS should be further assessed and considered as a potential contaminant of concern in groundwater or surface water (…) If PFAS are identified as a contaminant of concern for a site, they should be assessed as part of the remedy selection process in accordance with Part 375 and DER-10.	PFOA and PFOS should be further assessed and considered as potential contaminants of concern in groundwater or surface water (…) If PFOA and/or PFOS are identified as contaminants of concern for a site, they should be assessed as part of the remedy selection process in accordance with Part 375 and DER-10.	9/15/2020
Soil Sample Results, page 10	"The extent of soil contamination for purposes of delineation and remedy selection should be determined by having certain soil samples tested by Synthetic Precipitation Leaching Procedure (SPLP) and the leachate analyzed for PFAS. Soil exhibiting SPLP results above 70 ppt for either PFOA or PFOS (individually or combined) are to be evaluated during the cleanup phase."	"Soil cleanup objectives for PFOA and PFOS will be proposed in an upcoming revision to 6 NYCRR Part 375-6. Until SCOs are in effect, the following are to be used as guidance values. " [Interim SCO Table] "PFOA and PFOS results for soil are to be compared against the guidance values listed above. These guidance values are to be used in determining whether PFOA and PFOS are contaminants of concern for the site and for determining remedial action objectives and cleanup requirements. Site-specific remedial objectives for protection of groundwater can also be presented for evaluation by DEC. Development of site-specific remedial objectives for protection of groundwater will require analysis of additional soil parameters relating to leachability. These additional analyses can include any or all the parameters listed above (soil pH, cation exchange capacity, etc.) and/or use of SPLP. As the understanding of PFAS transport improves, DEC welcomes proposals for site-specific remedial objectives for protection of groundwater. DEC will expect that those may be dependent on additional factors including soil pH, aqueous pH, % organic carbon, % Sand/Silt/Clay, soil cations: K, Ca, Mg, Na, Fe, Al, cation exchange capacity, and anion exchange capacity. Site-specific remedial objectives should also consider the dilution attenuation factor (DAF). The NJDEP publication on DAF can be used as a reference: https://www.nj.gov/dep/srp/guidance/rs/daf.pdf. "	9/15/2020

Citation and Page Number	Current Text	Corrected Text	Date
Testing for Imported Soil Page 11	Soil imported to a site for use in a soil cap, soil cover, or as backfill is to be tested for PFAS in general conformance with DER-10, Section 5.4(e) for the PFAS Analyte List (Appendix F) using the analytical procedures discussed below and the criteria in DER-10 associated with SVOCs. If PFOA or PFOS is detected in any sample at or above 1 µg/kg, then soil should be tested by SPLP and the leachate analyzed for PFAS. If the SPLP results exceed 10 ppt for either PFOA or PFOS (individually) then the source of backfill should be rejected, unless a site-specific exemption is provided by DER. SPLP leachate criteria is based on the Maximum Contaminant Levels proposed for drinking water by New York State's Department of Health, this value may be updated based on future Federal or State promulgated regulatory standards. Remedial parties have the option of analyzing samples concurrently for both PFAS in soil and in the SPLP leachate to minimize project delays. Category B deliverables should be submitted for backfill samples, though a DUSR is not required.	Testing for PFAS should be included any time a full TAL/TCL analyte list is required. Results for PFOA and PFOS should be compared to the applicable guidance values. If PFOA or PFOS is detected in any sample at or above the guidance values then the source of backfill should be rejected, unless a site-specific exemption is provided by DER based on SPLP testing, for example. If the concentrations of PFOA and PFOS in leachate are at or above 10 ppt (the Maximum Contaminant Levels established for drinking water by the New York State Department of Health), then the soil is not acceptable. PFOA, PFOS and 1,4-dioxane are all considered semi-volatile compounds, so composite samples are appropriate for these compounds when sampling in accordance with DER-10, Table 5.4(e)10. Category B deliverables should be submitted for backfill samples, though a DUSR is not required.	9/15/2020

Citation and Page Number	Current Text	Corrected Text	Date
Footnotes	None	[1] TOP Assay analysis of highly contaminated samples, such as those from an AFFF (aqueous film-forming foam) site, can result in incomplete oxidation of the samples and an underestimation of the total perfluoroalkyl substances. [2] The movement of PFAS in the environment is being aggressively researched at this time; that research will eventually result in more accurate models for the behaviors of these chemicals. In the meantime, DEC has calculated the soil cleanup objective for the protection of groundwater using the same procedure used for all other chemicals, as described in Section 7.7 of the Technical Support Document (http://www.dec.ny.gov/docs/remediation_hudson_pdf/techsuppdoc.pdf).	9/15/2020
Additional Analysis, page 9	In cases… soil parameters, such as Total Organic Carbon (EPA Method 9060), soil…	In cases… soil parameters, such as Total Organic Carbon (Lloyd Kahn), soil…	1/8/2021
Appendix A, General Guidelines, fourth bullet	List the ELAP-approved lab(s) to be used for analysis of samples	List the ELAP- certified lab(s) to be used for analysis of samples	1/8/2021
Appendix E, Laboratory Analysis and Containers	Drinking water samples collected using this protocol are intended to be analyzed for PFAS by ISO Method 25101.	Drinking water samples collected using this protocol are intended to be analyzed for PFAS by EPA Method 537, 537.1, 533, or ISO Method 25101	1/8/2021

Sampling, Analysis, and Assessment of Per- and Polyfluoroalkyl Substances (PFAS) Under NYSDEC's Part 375 Remedial Programs

Objective

New York State Department of Environmental Conservation's Division of Environmental Remediation (DER) performs or oversees sampling of environmental media and subsequent analysis of PFAS as part of remedial programs implemented under 6 NYCRR Part 375. To ensure consistency in sampling, analysis, reporting, and assessment of PFAS, DER has developed this document which summarizes currently accepted procedures and updates previous DER technical guidance pertaining to PFAS.

Applicability

All work plans submitted to DEC pursuant to one of the remedial programs under Part 375 shall include PFAS sampling and analysis procedures that conform to the guidelines provided herein.

As part of a site investigation or remedial action compliance program, whenever samples of potentially affected media are collected and analyzed for the standard Target Analyte List/Target Compound List (TAL/TCL), PFAS analysis should also be performed. Potentially affected media can include soil, groundwater, surface water, and sediment. Based upon the potential for biota to be affected, biota sampling and analysis for PFAS may also be warranted as determined pursuant to a Fish and Wildlife Impact Analysis. Soil vapor sampling for PFAS is not required.

Field Sampling Procedures

DER-10 specifies technical guidance applicable to DER's remedial programs. Given the prevalence and use of PFAS, DER has developed "best management practices" specific to sampling for PFAS. As specified in DER-10 Chapter 2, quality assurance procedures are to be submitted with investigation work plans. Typically, these procedures are incorporated into a work plan, or submitted as a stand-alone document (e.g., a Quality Assurance Project Plan). Quality assurance guidelines for PFAS are listed in Appendix A - Quality Assurance Project Plan (QAPP) Guidelines for PFAS.

Field sampling for PFAS performed under DER remedial programs should follow the appropriate procedures outlined for soils, sediments or other solids (Appendix B), non-potable groundwater (Appendix C), surface water (Appendix D), public or private water supply wells (Appendix E), and fish tissue (Appendix F).

QA/QC samples (e.g. duplicates, MS/MSD) should be collected as specified in DER-10, Section 2.3(c). For sampling equipment coming in contact with aqueous samples only, rinsate or equipment blanks should be collected. Equipment blanks should be collected at a minimum frequency of one per day per site or one per twenty samples, whichever is more frequent.

Analysis and Reporting

As of October 2020, the United States Environmental Protection Agency (EPA) does not have a validated method for analysis of PFAS for media commonly analyzed under DER remedial programs (non-potable waters, solids). DER has developed the following guidelines to ensure consistency in analysis and reporting of PFAS.

The investigation work plan should describe analysis and reporting procedures, including laboratory analytical procedures for the methods discussed below. As specified in DER-10 Section 2.2, laboratories should provide a full Category B deliverable. In addition, a Data Usability Summary Report (DUSR) should be prepared by an independent, third party data validator. Electronic data submissions should meet the requirements provided at: https://www.dec.ny.gov/chemical/62440.html.

DER has developed a *PFAS Analyte List* (Appendix F) for remedial programs to understand the nature of contamination at sites. It is expected that reported results for PFAS will include, at a minimum, all the compounds listed. If lab and/or matrix specific issues are encountered for any analytes, the DER project manager, in consultation with the DER chemist, will make case-by-case decisions as to whether certain analytes may be temporarily or permanently discontinued from analysis at each site. As with other contaminants that are analyzed for at a site, the *PFAS Analyte List* may be refined for future sampling events based on investigative findings.

Routine Analysis

Currently, New York State Department of Health's Environmental Laboratory Approval Program (ELAP) does not offer certification for PFAS in matrices other than finished drinking water. However, laboratories analyzing environmental samples for PFAS (e.g., soil, sediments, and groundwater) under DER's Part 375 remedial programs need to hold ELAP certification for PFOA and PFOS in drinking water by EPA Method 537, 537.1, ISO 25101, or Method 533. Laboratories should adhere to the guidelines and criteria set forth in the DER's laboratory guidelines for PFAS in non-potable water and solids (Appendix H - Laboratory Guidelines for Analysis of PFAS in Non-Potable Water and Solids). Data review guidelines were developed by DER to ensure data comparability and usability (Appendix H - Data Review Guidelines for Analysis of PFAS in Non-Potable Water and Solids).

LC-MS/MS analysis for PFAS using methodologies based on EPA Method 537.1 is the procedure to use for environmental samples. Isotope dilution techniques should be utilized for the analysis of PFAS in all media. Reporting limits for PFOA and PFOS in aqueous samples should not exceed 2 ng/L. Reporting limits for PFOA and PFOS in solid samples should not exceed 0.5 µg/kg. Reporting limits for all other PFAS in aqueous and solid media should be as close to these limits as possible. If laboratories indicate that they are not able to achieve these reporting limits for the entire *PFAS Analyte List*, site-specific decisions regarding acceptance of elevated reporting limits for specific PFAS can be made by the DER project manager in consultation with the DER chemist.

Additional Analysis

Additional laboratory methods for analysis of PFAS may be warranted at a site, such as the Synthetic Precipitation Leaching Procedure (SPLP) and Total Oxidizable Precursor Assay (TOP Assay).

In cases where site-specific cleanup objectives for PFOA and PFOS are to be assessed, soil parameters, such as Total Organic Carbon (Lloyd Kahn), soil pH (EPA Method 9045), clay content (percent), and cation exchange capacity (EPA Method 9081), should be included in the analysis to help evaluate factors affecting the leachability of PFAS in site soils.

SPLP is a technique used to determine the mobility of chemicals in liquids, soils and wastes, and may be useful in determining the need for addressing PFAS-containing material as part of the remedy. SPLP by EPA Method 1312 should be used unless otherwise specified by the DER project manager in consultation with the DER chemist.

Impacted materials can be made up of PFAS that are not analyzable by routine analytical methodology. A TOP Assay can be utilized to conceptualize the amount and type of oxidizable PFAS which could be liberated in the environment, which approximates the maximum concentration of perfluoroalkyl substances that could be generated

if all polyfluoroalkyl substances were oxidized. For example, some polyfluoroalkyl substances may degrade or transform to form perfluoroalkyl substances (such as PFOA or PFOS), resulting in an increase in perfluoroalkyl substance concentrations as contaminated groundwater moves away from a source. The TOP Assay converts, through oxidation, polyfluoroalkyl substances (precursors) into perfluoroalkyl substances that can be detected by routine analytical methodology.[1]

Commercial laboratories have adopted methods which allow for the quantification of targeted PFAS in air and biota. The EPA's Office of Research and Development (ORD) is currently developing methods which allow for air emissions characterization of PFAS, including both targeted and non-targeted analysis of PFAS. Consult with the DER project manager and the DER chemist for assistance on analyzing biota/tissue and air samples.

Data Assessment and Application to Site Cleanup

Until such time as Ambient Water Quality Standards (AWQS) and Soil Cleanup Objectives (SCOs) for PFOA and PFOS are published, the extent of contaminated media potentially subject to remediation should be determined on a case-by-case basis using the procedures discussed below and the criteria in DER-10. Preliminary target levels for cleanup of PFOA and PFOS in other media, including biota and sediment, have not yet been established by the DEC.

Water Sample Results

PFOA and PFOS should be further assessed and considered as potential contaminants of concern in groundwater or surface water if PFOA or PFOS is detected in any water sample at or above 10 ng/L (ppt) and is determined to be attributable to the site, either by a comparison of upgradient and downgradient levels, or the presence of soil source areas, as defined below. In addition, further assessment of water may be warranted if either of the following screening levels are met:

a. any other individual PFAS (not PFOA or PFOS) is detected in water at or above 100 ng/L; or
b. total concentration of PFAS (including PFOA and PFOS) is detected in water at or above 500 ng/L

If PFOA and/or PFOS are identified as contaminants of concern for a site, they should be assessed as part of the remedy selection process in accordance with Part 375 and DER-10.

Soil Sample Results

Soil cleanup objectives for PFOA and PFOS will be proposed in an upcoming revision to 6 NYCRR Part 375-6. Until SCOs are in effect, the following are to be used as guidance values.

Guidance Values for Anticipated Site Use	PFOA (ppb)	PFOS (ppb)
Unrestricted	0.66	0.88
Residential	6.6	8.8
Restricted Residential	33	44
Commercial	500	440
Industrial	600	440
Protection of Groundwater[2]	1.1	3.7

[1] TOP Assay analysis of highly contaminated samples, such as those from an AFFF (aqueous film-forming foam) site, can result in incomplete oxidation of the samples and an underestimation of the total perfluoroalkyl substances.
[2] The movement of PFAS in the environment is being aggressively researched at this time; that research will eventually result in more accurate models for the behaviors of these chemicals. In the meantime, DEC has calculated the guidance value for the protection of groundwater using the same procedure used for all other chemicals, as described in Section 7.7 of the Technical Support Document (http://www.dec.ny.gov/docs/remediation_hudson_pdf/techsuppdoc.pdf).

PFOA and PFOS results for soil are to be compared against the guidance values listed above. These guidance values are to be used in determining whether PFOA and PFOS are contaminants of concern for the site and for determining remedial action objectives and cleanup requirements. Site-specific remedial objectives for protection of groundwater can also be presented for evaluation by DEC. Development of site-specific remedial objectives for protection of groundwater will require analysis of additional soil parameters relating to leachability. These additional analyses can include any or all the parameters listed above (soil pH, cation exchange capacity, etc.) and/or use of SPLP.

As the understanding of PFAS transport improves, DEC welcomes proposals for site-specific remedial objectives for protection of groundwater. DEC will expect that those may be dependent on additional factors including soil pH, aqueous pH, % organic carbon, % Sand/Silt/Clay, soil cations: K, Ca, Mg, Na, Fe, Al, cation exchange capacity, and anion exchange capacity. Site-specific remedial objectives should also consider the dilution attenuation factor (DAF). The NJDEP publication on DAF can be used as a reference: https://www.nj.gov/dep/srp/guidance/rs/daf.pdf.

Testing for Imported Soil

Testing for PFAS should be included any time a full TAL/TCL analyte list is required. Results for PFOA and PFOS should be compared to the applicable guidance values. If PFOA or PFOS is detected in any sample at or above the guidance values then the source of backfill should be rejected, unless a site-specific exemption is provided by DER based on SPLP testing, for example. If the concentrations of PFOA and PFOS in leachate are at or above 10 ppt (the Maximum Contaminant Levels established for drinking water by the New York State Department of Health), then the soil is not acceptable.

PFOA, PFOS and 1,4-dioxane are all considered semi-volatile compounds, so composite samples are appropriate for these compounds when sampling in accordance with DER-10, Table 5.4(e)10. Category B deliverables should be submitted for backfill samples, though a DUSR is not required.

Appendix A - Quality Assurance Project Plan (QAPP) Guidelines for PFAS

The following guidelines (general and PFAS-specific) can be used to assist with the development of a QAPP for projects within DER involving sampling and analysis of PFAS.

General Guidelines in Accordance with DER-10

- Document/work plan section title – Quality Assurance Project Plan
- Summarize project scope, goals, and objectives
- Provide project organization including names and resumes of the project manager, Quality Assurance Officer (QAO), field staff, and Data Validator
    - The QAO should not have another position on the project, such as project or task manager, that involves project productivity or profitability as a job performance criterion
- List the ELAP certified lab(s) to be used for analysis of samples
- Include a site map showing sample locations
- Provide detailed sampling procedures for each matrix
- Include Data Quality Usability Objectives
- List equipment decontamination procedures
- Include an "Analytical Methods/Quality Assurance Summary Table" specifying:
    - Matrix type
    - Number or frequency of samples to be collected per matrix
    - Number of field and trip blanks per matrix
    - Analytical parameters to be measured per matrix
    - Analytical methods to be used per matrix with minimum reporting limits
    - Number and type of matrix spike and matrix spike duplicate samples to be collected
    - Number and type of duplicate samples to be collected
    - Sample preservation to be used per analytical method and sample matrix
    - Sample container volume and type to be used per analytical method and sample matrix
    - Sample holding time to be used per analytical method and sample matrix
- Specify Category B laboratory data deliverables and preparation of a DUSR

Specific Guidelines for PFAS

- Include in the text that sampling for PFAS will take place
- Include in the text that PFAS will be analyzed by LC-MS/MS for PFAS using methodologies based on EPA Method 537.1
- Include the list of PFAS compounds to be analyzed (*PFAS Analyte List*)
- Include the laboratory SOP for PFAS analysis
- List the minimum method-achievable Reporting Limits for PFAS
    - Reporting Limits should be less than or equal to:
        - Aqueous – 2 ng/L (ppt)
        - Solids – 0.5 µg/kg (ppb)
- Include the laboratory Method Detection Limits for the PFAS compounds to be analyzed
- Laboratory should have ELAP certification for PFOA and PFOS in drinking water by EPA Method 537, 537.1, EPA Method 533, or ISO 25101
- Include detailed sampling procedures
    - Precautions to be taken
    - Pump and equipment types
    - Decontamination procedures
    - Approved materials only to be used
- Specify that regular ice only will be used for sample shipment
- Specify that equipment blanks should be collected at a minimum frequency of 1 per day per site for each matrix

Appendix B - Sampling Protocols for PFAS in Soils, Sediments and Solids

General

The objective of this protocol is to give general guidelines for the collection of soil, sediment and other solid samples for PFAS analysis. The sampling procedure used should be consistent with Sampling Guidelines and Protocols – Technological Background and Quality Control/Quality Assurance for NYS DEC Spill Response Program – March 1991 (http://www.dec.ny.gov/docs/remediation_hudson_pdf/sgpsect5.pdf), with the following limitations.

Laboratory Analysis and Containers

Samples collected using this protocol are intended to be analyzed for PFAS using methodologies based on EPA Method 537.1.

The preferred material for containers is high density polyethylene (HDPE). Pre-cleaned sample containers, coolers, sample labels, and a chain of custody form will be provided by the laboratory.

Equipment

Acceptable materials for sampling include stainless steel, HDPE, PVC, silicone, acetate, and polypropylene. Additional materials may be acceptable if pre-approved by New York State Department of Environmental Conservation's Division of Environmental Remediation.

No sampling equipment components or sample containers should come in to contact with aluminum foil, low density polyethylene, glass, or polytetrafluoroethylene (PTFE, Teflon™) materials including sample bottle cap liners with a PTFE layer.

A list of acceptable equipment is provided below, but other equipment may be considered appropriate based on sampling conditions.

- stainless steel spoon
- stainless steel bowl
- steel hand auger or shovel without any coatings

Equipment Decontamination

Standard two step decontamination using detergent (Alconox is acceptable) and clean, PFAS-free water will be performed for sampling equipment. All sources of water used for equipment decontamination should be verified in advance to be PFAS-free through laboratory analysis or certification.

Sampling Techniques

Sampling is often conducted in areas where a vegetative turf has been established. In these cases, a pre-cleaned trowel or shovel should be used to carefully remove the turf so that it may be replaced at the conclusion of sampling. Surface soil samples (e.g. 0 to 6 inches below surface) should then be collected using a pre-cleaned, stainless steel spoon. Shallow subsurface soil samples (e.g. 6 to ~36 inches below surface) may be collected by digging a hole using a pre-cleaned hand auger or shovel. When the desired subsurface depth is reached, a pre-cleaned hand auger or spoon shall be used to obtain the sample.

When the sample is obtained, it should be deposited into a stainless steel bowl for mixing prior to filling the sample containers. The soil should be placed directly into the bowl and mixed thoroughly by rolling the material into the middle until the material is homogenized. At this point the material within the bowl can be placed into the laboratory provided container.

Sample Identification and Logging

A label shall be attached to each sample container with a unique identification. Each sample shall be included on the chain of custody (COC).

Quality Assurance/Quality Control

- Immediately place samples in a cooler maintained at 4 ± 2º Celsius using ice
- Collect one field duplicate for every sample batch, minimum 1 duplicate per 20 samples. The duplicate shall consist of an additional sample at a given location
- Collect one matrix spike / matrix spike duplicate (MS/MSD) for every sample batch, minimum 1 MS/MSD per 20 samples. The MS/MSD shall consist of an additional two samples at a given location and identified on the COC
- Request appropriate data deliverable (Category B) and an electronic data deliverable

Documentation

A soil log or sample log shall document the location of the sample/borehole, depth of the sample, sampling equipment, duplicate sample, visual description of the material, and any other observations or notes determined to be appropriate. Additionally, care should be performed to limit contact with PFAS containing materials (e.g. waterproof field books, food packaging) during the sampling process.

Personal Protection Equipment (PPE)

For most sampling Level D PPE is anticipated to be appropriate. The sampler should wear nitrile gloves while conducting field work and handling sample containers.

Field staff shall consider the clothing to be worn during sampling activities. Clothing that contains PTFE material (including GORE-TEX®) or that have been waterproofed with PFAS materials should be avoided. All clothing worn by sampling personnel should have been laundered multiple times.

Appropriate rain gear (PVC, polyurethane, or rubber rain gear are acceptable), bug spray, and sunscreen should be used that does not contain PFAS. Well washed cotton coveralls may be used as an alternative to bug spray and/or sunscreen.

PPE that contains PFAS is acceptable when site conditions warrant additional protection for the samplers and no other materials can be used to be protective. Documentation of such use should be provided in the field notes.

Appendix C - Sampling Protocols for PFAS in Monitoring Wells

General

The objective of this protocol is to give general guidelines for the collection of groundwater samples for PFAS analysis. The sampling procedure used should be consistent with Sampling Guidelines and Protocols – Technological Background and Quality Control/Quality Assurance for NYS DEC Spill Response Program – March 1991 (http://www.dec.ny.gov/docs/remediation_hudson_pdf/sgpsect5.pdf), with the following limitations.

Laboratory Analysis and Container

Samples collected using this protocol are intended to be analyzed for PFAS using methodologies based on EPA Method 537.1.

The preferred material for containers is high density polyethylene (HDPE). Pre-cleaned sample containers, coolers, sample labels, and a chain of custody form will be provided by the laboratory.

Equipment

Acceptable materials for sampling include: stainless steel, HDPE, PVC, silicone, acetate, and polypropylene. Additional materials may be acceptable if pre-approved by New York State Department of Environmental Conservation's Division of Environmental Remediation.

No sampling equipment components or sample containers should come in contact with aluminum foil, low density polyethylene, glass, or polytetrafluoroethylene (PTFE, Teflon™) materials including plumbers tape and sample bottle cap liners with a PTFE layer.

A list of acceptable equipment is provided below, but other equipment may be considered appropriate based on sampling conditions.

- stainless steel inertia pump with HDPE tubing
- peristaltic pump equipped with HDPE tubing and silicone tubing
- stainless steel bailer with stainless steel ball
- bladder pump (identified as PFAS-free) with HDPE tubing

Equipment Decontamination

Standard two step decontamination using detergent (Alconox is acceptable) and clean, PFAS-free water will be performed for sampling equipment. All sources of water used for equipment decontamination should be verified in advance to be PFAS-free through laboratory analysis or certification.

Sampling Techniques

Monitoring wells should be purged in accordance with the sampling procedure (standard/volume purge or low flow purge) identified in the site work plan, which will determine the appropriate time to collect the sample. If sampling using standard purge techniques, additional purging may be needed to reduce turbidity levels, so samples contain a limited amount of sediment within the sample containers. Sample containers that contain sediment may cause issues at the laboratory, which may result in elevated reporting limits and other issues during the sample preparation that can compromise data usability. Sampling personnel should don new nitrile gloves prior to sample collection due to the potential to contact PFAS containing items (not related to the sampling equipment) during the purging activities.

Sample Identification and Logging

A label shall be attached to each sample container with a unique identification. Each sample shall be included on the chain of custody (COC).

Quality Assurance/Quality Control

- Immediately place samples in a cooler maintained at 4 ± 2º Celsius using ice
- Collect one field duplicate for every sample batch, minimum 1 duplicate per 20 samples. The duplicate shall consist of an additional sample at a given location
- Collect one matrix spike / matrix spike duplicate (MS/MSD) for every sample batch, minimum 1 MS/MSD per 20 samples. The MS/MSD shall consist of an additional two samples at a given location and identified on the COC
- Collect one equipment blank per day per site and minimum 1 equipment blank per 20 samples. The equipment blank shall test the new and decontaminated sampling equipment utilized to obtain a sample for residual PFAS contamination. This sample is obtained by using laboratory provided PFAS-free water and passing the water over or through the sampling device and into laboratory provided sample containers
- Additional equipment blank samples may be collected to assess other equipment that is utilized at the monitoring well
- Request appropriate data deliverable (Category B) and an electronic data deliverable

Documentation

A purge log shall document the location of the sample, sampling equipment, groundwater parameters, duplicate sample, visual description of the material, and any other observations or notes determined to be appropriate. Additionally, care should be performed to limit contact with PFAS containing materials (e.g. waterproof field books, food packaging) during the sampling process.

Personal Protection Equipment (PPE)

For most sampling Level D PPE is anticipated to be appropriate. The sampler should wear nitrile gloves while conducting field work and handling sample containers.

Field staff shall consider the clothing to be worn during sampling activities. Clothing that contains PTFE material (including GORE-TEX®) or that have been waterproofed with PFAS materials should be avoided. All clothing worn by sampling personnel should have been laundered multiple times.

Appropriate rain gear (PVC, polyurethane, or rubber rain gear are acceptable), bug spray, and sunscreen should be used that does not contain PFAS. Well washed cotton coveralls may be used as an alternative to bug spray and/or sunscreen.

PPE that contains PFAS is acceptable when site conditions warrant additional protection for the samplers and no other materials can be used to be protective. Documentation of such use should be provided in the field notes.

Appendix D - Sampling Protocols for PFAS in Surface Water

General

The objective of this protocol is to give general guidelines for the collection of surface water samples for PFAS analysis. The sampling procedure used should be consistent with Sampling Guidelines and Protocols – Technological Background and Quality Control/Quality Assurance for NYS DEC Spill Response Program – March 1991 (http://www.dec.ny.gov/docs/remediation_hudson_pdf/sgpsect5.pdf), with the following limitations.

Laboratory Analysis and Container

Samples collected using this protocol are intended to be analyzed for PFAS using methodologies based on EPA Method 537.1.

The preferred material for containers is high density polyethylene (HDPE). Pre-cleaned sample containers, coolers, sample labels, and a chain of custody form will be provided by the laboratory.

Equipment

Acceptable materials for sampling include: stainless steel, HDPE, PVC, silicone, acetate, and polypropylene. Additional materials may be acceptable if pre-approved by New York State Department of Environmental Conservation's Division of Environmental Remediation.

No sampling equipment components or sample containers should come in contact with aluminum foil, low density polyethylene, glass, or polytetrafluoroethylene (PTFE, Teflon™) materials including sample bottle cap liners with a PTFE layer.

A list of acceptable equipment is provided below, but other equipment may be considered appropriate based on sampling conditions.

- stainless steel cup

Equipment Decontamination

Standard two step decontamination using detergent (Alconox is acceptable) and clean, PFAS-free water will be performed for sampling equipment. All sources of water used for equipment decontamination should be verified in advance to be PFAS-free through laboratory analysis or certification.

Sampling Techniques

Where conditions permit, (e.g. creek or pond) sampling devices (e.g. stainless steel cup) should be rinsed with site medium to be sampled prior to collection of the sample. At this point the sample can be collected and poured into the sample container.

If site conditions permit, samples can be collected directly into the laboratory container.

Sample Identification and Logging

A label shall be attached to each sample container with a unique identification. Each sample shall be included on the chain of custody (COC).

Quality Assurance/Quality Control

- Immediately place samples in a cooler maintained at 4 ± 2º Celsius using ice
- Collect one field duplicate for every sample batch, minimum 1 duplicate per 20 samples. The duplicate shall consist of an additional sample at a given location
- Collect one matrix spike / matrix spike duplicate (MS/MSD) for every sample batch, minimum 1 MS/MSD per 20 samples. The MS/MSD shall consist of an additional two samples at a given location and identified on the COC
- Collect one equipment blank per day per site and minimum 1 equipment blank per 20 samples. The equipment blank shall test the new and decontaminated sampling equipment utilized to obtain a sample for residual PFAS contamination. This sample is obtained by using laboratory provided PFAS-free water and passing the water over or through the sampling device and into laboratory provided sample containers
- Request appropriate data deliverable (Category B) and an electronic data deliverable

Documentation

A sample log shall document the location of the sample, sampling equipment, duplicate sample, visual description of the material, and any other observations or notes determined to be appropriate. Additionally, care should be performed to limit contact with PFAS containing materials (e.g. waterproof field books, food packaging) during the sampling process.

Personal Protection Equipment (PPE)

For most sampling Level D PPE is anticipated to be appropriate. The sampler should wear nitrile gloves while conducting field work and handling sample containers.

Field staff shall consider the clothing to be worn during sampling activities. Clothing that contains PTFE material (including GORE-TEX®) or that have been waterproofed with PFAS materials should be avoided. All clothing worn by sampling personnel should have been laundered multiple times.

Appropriate rain gear (PVC, polyurethane, or rubber rain gear are acceptable), bug spray, and sunscreen should be used that does not contain PFAS. Well washed cotton coveralls may be used as an alternative to bug spray and/or sunscreen.

PPE that contains PFAS is acceptable when site conditions warrant additional protection for the samplers and no other materials can be used to be protective. Documentation of such use should be provided in the field notes.

Appendix E - Sampling Protocols for PFAS in Private Water Supply Wells

General

The objective of this protocol is to give general guidelines for the collection of water samples from private water supply wells (with a functioning pump) for PFAS analysis. The sampling procedure used should be consistent with Sampling Guidelines and Protocols – Technological Background and Quality Control/Quality Assurance for NYS DEC Spill Response Program – March 1991 (http://www.dec.ny.gov/docs/remediation_hudson_pdf/sgpsect5.pdf), with the following limitations.

Laboratory Analysis and Container

Drinking water samples collected using this protocol are intended to be analyzed for PFAS by EPA Method 537, 537.1, 533, or ISO Method 25101. The preferred material for containers is high density polyethylene (HDPE). Pre-cleaned sample containers, coolers, sample labels, and a chain of custody form will be provided by the laboratory.

Equipment

Acceptable materials for sampling include stainless steel, HDPE, PVC, silicone, acetate, and polypropylene. Additional materials may be acceptable if pre-approved by New York State Department of Environmental Conservation's Division of Environmental Remediation.

No sampling equipment components or sample containers should come in contact with aluminum foil, low density polyethylene, glass, or polytetrafluoroethylene (PTFE, Teflon™) materials (e.g. plumbers tape), including sample bottle cap liners with a PTFE layer.

Equipment Decontamination

Standard two step decontamination using detergent (Alconox is acceptable) and clean, PFAS-free water will be performed for sampling equipment. All sources of water used for equipment decontamination should be verified in advance to be PFAS-free through laboratory analysis or certification.

Sampling Techniques

Locate and assess the pressure tank and determine if any filter units are present within the building. Establish the sample location as close to the well pump as possible, which is typically the spigot at the pressure tank. Ensure sampling equipment is kept clean during sampling as access to the pressure tank spigot, which is likely located close to the ground, may be obstructed and may hinder sample collection.

Prior to sampling, a faucet downstream of the pressure tank (e.g., washroom sink) should be run until the well pump comes on and a decrease in water temperature is noted which indicates that the water is coming from the well. If the homeowner is amenable, staff should run the water longer to purge the well (15+ minutes) to provide a sample representative of the water in the formation rather than standing water in the well and piping system including the pressure tank. At this point a new pair of nitrile gloves should be donned and the sample can be collected from the sample point at the pressure tank.

Sample Identification and Logging

A label shall be attached to each sample container with a unique identification. Each sample shall be included on the chain of custody (COC).

Quality Assurance/Quality Control

- Immediately place samples in a cooler maintained at 4 ± 2º Celsius using ice
- Collect one field duplicate for every sample batch, minimum 1 duplicate per 20 samples. The duplicate shall consist of an additional sample at a given location
- Collect one matrix spike / matrix spike duplicate (MS/MSD) for every sample batch, minimum 1 MS/MSD per 20 samples. The MS/MSD shall consist of an additional two samples at a given location and identified on the COC
- If equipment was used, collect one equipment blank per day per site and a minimum 1 equipment blank per 20 samples. The equipment blank shall test the new and decontaminated sampling equipment utilized to obtain a sample for residual PFAS contamination. This sample is obtained by using laboratory provided PFAS-free water and passing the water over or through the sampling device and into laboratory provided sample containers.
- A field reagent blank (FRB) should be collected at a rate of one per 20 samples. The lab will provide a FRB bottle containing PFAS free water and one empty FRB bottle. In the field, pour the water from the one bottle into the empty FRB bottle and label appropriately.
- Request appropriate data deliverable (Category B) and an electronic data deliverable
- For sampling events where multiple private wells (homes or sites) are to be sampled per day, it is acceptable to collect QC samples at a rate of one per 20 across multiple sites or days.

Documentation

A sample log shall document the location of the private well, sample point location, owner contact information, sampling equipment, purge duration, duplicate sample, visual description of the material, and any other observations or notes determined to be appropriate and available (e.g. well construction, pump type and location, yield, installation date). Additionally, care should be performed to limit contact with PFAS containing materials (e.g. waterproof field books, food packaging) during the sampling process.

Personal Protection Equipment (PPE)

For most sampling Level D PPE is anticipated to be appropriate. The sampler should wear nitrile gloves while conducting field work and handling sample containers.

Field staff shall consider the clothing to be worn during sampling activities. Clothing that contains PTFE material (including GORE-TEX®) or that have been waterproofed with PFAS materials should be avoided. All clothing worn by sampling personnel should have been laundered multiple times.

Appendix F - Sampling Protocols for PFAS in Fish

This appendix contains a copy of the latest guidelines developed by the Division of Fish and Wildlife (DFW) entitled “General Fish Handling Procedures for Contaminant Analysis” (Ver. 8).

Procedure Name: General Fish Handling Procedures for Contaminant Analysis

Number: FW-005

Purpose: This procedure describes data collection, fish processing and delivery of fish collected for contaminant monitoring. It contains the chain of custody and collection record forms that should be used for the collections.

Organization: Environmental Monitoring Section
Bureau of Ecosystem Health
Division of Fish and Wildlife (DFW)
New York State Department of Environmental Conservation (NYSDEC)
625 Broadway
Albany, New York 12233-4756

Version: 8

Previous Version Date: 21 March 2018

Summary of Changes to this Version: Updated bureau name to Bureau of Ecosystem Health. Added direction to list the names of all field crew on the collection record. Minor formatting changes on chain of custody and collection records.

Originator or Revised by: Wayne Richter, Jesse Becker

Date: 26 April 2019

Quality Assurance Officer and Approval Date: Jesse Becker, 26 April 2019

NEW YORK STATE
DEPARTMENT OF ENVIRONMENTAL CONSERVATION

GENERAL FISH HANDLING PROCEDURES FOR CONTAMINANT ANALYSES

A. Original copies of all continuity of evidence (i.e., Chain of Custody) and collection record forms must accompany delivery of fish to the lab. A copy shall be directed to the Project Leader or as appropriate, Wayne Richter. All necessary forms will be supplied by the Bureau of Ecosystem Health. Because some samples may be used in legal cases, it is critical that each section is filled out completely. Each Chain of Custody form has three main sections:

   1. The top box is to be filled out **and signed** by the person responsible for the fish collection (e.g., crew leader, field biologist, researcher). This person is responsible for delivery of the samples to DEC facilities or personnel (e.g., regional office or biologist).

   2. The second section is to be filled out **and signed** by the person responsible for the collections while being stored at DEC, before delivery to the analytical lab. This may be the same person as in (1), but it is still required that they complete the section. Also important is the **range of identification numbers** (i.e., tag numbers) included in the sample batch.

   3. Finally, the bottom box is to record any transfers between DEC personnel and facilities. Each subsequent transfer should be **identified, signed, and dated**, until laboratory personnel take possession of the fish.

B. The following data are required on each **Fish Collection Record** form:

   1. Project and Site Name.

   2. DEC Region.

   3. All personnel (and affiliation) involved in the collection.

   4. Method of collection (gill net, hook and line, etc.)

   5. Preservation Method.

C. The following data are to be taken on each fish collected and recorded on the **Fish Collection Record** form:

   1. Tag number - Each specimen is to be individually jaw tagged at time of collection with a unique number. Make sure the tag is turned out so that the number can be read without opening the bag. Use tags in sequential order. For small fish or composite samples place the tag inside the bag with the samples. The Bureau of Ecosystem Health can supply the tags.

   2. Species identification (please be explicit enough to enable assigning genus and species). Group fish by species when processing.

   3. Date collected.

   4. Sample location (waterway and nearest prominent identifiable landmark).

   5. Total length (nearest mm or smallest sub-unit on measuring instrument) and weight (nearest g or

smallest sub-unit of weight on weighing instrument). Take all measures as soon as possible with calibrated, protected instruments (e.g. from wind and upsets) and prior to freezing.

6. Sex - fish may be cut enough to allow sexing or other internal investigation, but do not eviscerate. Make any incision on the right side of the belly flap or exactly down the midline so that a left-side fillet can be removed.

D. General data collection recommendations:

1. It is helpful to use an ID or tag number that will be unique. It is best to use metal striped bass or other uniquely numbered metal tags. If uniquely numbered tags are unavailable, values based on the region, water body and year are likely to be unique: for example, R7CAY11001 for Region 7, Cayuga Lake, 2011, fish 1. If the fish are just numbered 1 through 20, we have to give them new numbers for our database, making it more difficult to trace your fish to their analytical results and creating an additional possibility for errors.

2. Process and record fish of the same species sequentially. Recording mistakes are less likely when all fish from a species are processed together. Starting with the bigger fish species helps avoid missing an individual.

3. If using Bureau of Ecosystem Health supplied tags or other numbered tags, use tags in sequence so that fish are recorded with sequential Tag Numbers. This makes data entry and login at the lab and use of the data in the future easier and reduces keypunch errors.

4. Record length and weight as soon as possible after collection and before freezing. Other data are recorded in the field upon collection. An age determination of each fish is optional, but if done, it is recorded in the appropriate “Age” column.

5. For composite samples of small fish, record the number of fish in the composite in the Remarks column. Record the length and weight of each individual in a composite. All fish in a composite sample should be of the same species and members of a composite should be visually matched for size.

6. Please submit photocopies of topographic maps or good quality navigation charts indicating sampling locations. GPS coordinates can be entered in the Location column of the collection record form in addition to or instead for providing a map. These records are of immense help to us (and hopefully you) in providing documented location records which are not dependent on memory and/or the same collection crew. In addition, they may be helpful for contaminant source trackdown and remediation/control efforts of the Department.

7. When recording data on fish measurements, it will help to ensure correct data recording for the data recorder to call back the numbers to the person making the measurements.

E. Each fish is to be placed in its own individual plastic bag. For small fish to be analyzed as a composite, put all of the fish for one composite in the same bag but use a separate bag for each composite. It is important to individually bag the fish to avoid difficulties or cross contamination when processing the fish for chemical analysis. Be sure to include the fish’s tag number inside the bag, preferably attached to the fish with the tag number turned out so it can be read. Tie or otherwise secure the bag closed. **The Bureau of Ecosystem Health will supply the bags.** If necessary, food grade bags may be procured from a suitable vendor (e.g., grocery store). It is preferable to redundantly label each bag with a manila tag tied between the knot and the body of the bag. This tag should be labeled with the project name, collection location, tag number, collection date, and fish species. If scales are collected, the scale envelope should be labeled with

the same information.

F. Groups of fish, by species, are to be placed in one large plastic bag per sampling location. **The Bureau of Ecosystem Health will supply the larger bags.** Tie or otherwise secure the bag closed. Label the site bag with a manila tag tied between the knot and the body of the bag. The tag should contain: project, collection location, collection date, species and **tag number ranges**. Having this information on the manila tag enables lab staff to know what is in the bag without opening it.

G. Do not eviscerate, fillet or otherwise dissect the fish unless specifically asked to. If evisceration or dissection is specified, the fish must be cut along the exact midline or on the right side so that the left side fillet can be removed intact at the laboratory. If filleting is specified, the procedure for taking a standard fillet (SOP PREPLAB 4) must be followed, including removing scales.

H. Special procedures for PFAS: Unlike legacy contaminants such as PCBs, which are rarely found in day to day life, PFAS are widely used and frequently encountered. Practices that avoid sample contamination are therefore necessary. While no standard practices have been established for fish, procedures for water quality sampling can provide guidance. The following practices should be used for collections when fish are to be analyzed for PFAS:

No materials containing Teflon.
No Post-it notes.
No ice packs; only water ice or dry ice.
Any gloves worn must be powder free nitrile.
No Gore-Tex or similar materials (Gore-Tex is a PFC with PFOA used in its manufacture).
No stain repellent or waterproof treated clothing; these are likely to contain PFCs.
Avoid plastic materials, other than HDPE, including clipboards and waterproof notebooks.
Wash hands after handling any food containers or packages as these may contain PFCs.
Keep pre-wrapped food containers and wrappers isolated from fish handling.
Wear clothing washed at least six times since purchase.
Wear clothing washed without fabric softener.
Staff should avoid cosmetics, moisturizers, hand creams and similar products on the day of sampling as many of these products contain PFCs (Fujii et al. 2013). Sunscreen or insect repellent should not contain ingredients with “fluor” in their name. Apply any sunscreen or insect repellent well downwind from all materials. Hands must be washed after touching any of these products.

I. All fish must be kept at a temperature <45° F (<8° C) immediately following data processing. As soon as possible, freeze at -20° C ± 5° C. Due to occasional freezer failures, daily freezer temperature logs are required. The freezer should be locked or otherwise secured to maintain chain of custody.

J. In most cases, samples should be delivered to the Analytical Services Unit at the Hale Creek field station. Coordinate delivery with field station staff and send copies of the collection records, continuity of evidence forms and freezer temperature logs to the field station. For samples to be analyzed elsewhere, non-routine collections or other questions, contact Wayne Richter, Bureau of Ecosystem Health, NYSDEC, 625 Broadway, Albany, New York 12233-4756, 518-402-8974, or the project leader about sample transfer. Samples will then be directed to the analytical facility and personnel noted on specific project descriptions.

K. A recommended equipment list is at the end of this document.

NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION
DIVISION OF FISH AND WILDLIFE
FISH COLLECTION RECORD

Project and Site Name _____ DEC Region _____

Collections made by (include all crew) _____

Sampling Method: □Electrofishing □Gill netting □Trap netting □Trawling □Seining □Angling □Other _____

Preservation Method: □Freezing □Other _____ Notes (SWFDB survey number): _____

FOR LAB USE ONLY- LAB ENTRY NO.	COLLECTION OR TAG NO.	SPECIES	DATE TAKEN	LOCATION	AGE	SEX &/OR REPROD. CONDIT	LENGTH ( )	WEIGHT ( )	REMARKS

richter: revised 2011, 5/7/15, 10/4/16, 3/20/17; becker: 3/23/17, 4/26/19

NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION
CHAIN OF CUSTODY

I, _____, of _____ collected the
(Print Name) (Print Business Address)

following on _____, 20____ from _____
(Date) (Water Body)

in the vicinity of _____
(Landmark, Village, Road, etc.)

Town of _____, in _____ County.

Item(s) _____

_____

Said sample(s) were in my possession and handled according to standard procedures provided to me prior to collection. The sample(s) were placed in the custody of a representative of the New York State Department of Environmental Conservation on _____, 20_____.

_____ _____
Signature Date

I, _____, received the above mentioned sample(s) on the date specified and assigned identification number(s) _____ to the sample(s). I have recorded pertinent data for the sample(s) on the attached collection records. The sample(s) remained in my custody until subsequently transferred, prepared or shipped at times and on dates as attested to below.

_____ _____
Signature Date

SECOND RECIPIENT (Print Name)	TIME & DATE	PURPOSE OF TRANSFER
SIGNATURE	UNIT	
THIRD RECIPIENT (Print Name)	TIME & DATE	PURPOSE OF TRANSFER
SIGNATURE	UNIT	
FOURTH RECIPIENT (Print Name)	TIME & DATE	PURPOSE OF TRANSFER
SIGNATURE	UNIT	
RECEIVED IN LABORATORY BY (Print Name)	TIME & DATE	REMARKS
SIGNATURE	UNIT	
LOGGED IN BY (Print Name)	TIME & DATE	ACCESSION NUMBERS
SIGNATURE	UNIT	

richter: revised 21 April 2014; becker: 23 March 2017, 26 April, 2019

NOTICE OF WARRANTY

By signature to the chain of custody (reverse), the signatory warrants that the information provided is truthful and accurate to the best of his/her ability. The signatory affirms that he/she is willing to testify to those facts provided and the circumstances surrounding the same. Nothing in this warranty or chain of custody negates responsibility nor liability of the signatories for the truthfulness and accuracy of the statements provided.

HANDLING INSTRUCTIONS

On day of collection, collector(s) name(s), address(es), date, geographic location of capture (attach a copy of topographic map or navigation chart), species, number kept of each species, and description of capture vicinity (proper noun, if possible) along with name of Town and County must be indicated on reverse.

Retain organisms in manila tagged plastic bags to avoid mixing capture locations. Note appropriate information on each bag tag.

Keep samples as cool as possible. Put on ice if fish cannot be frozen within 12 hours. If fish are held more than 24 hours without freezing, they will not be retained or analyzed.

Initial recipient (either DEC or designated agent) of samples from collector(s) is responsible for obtaining and recording information on the collection record forms which will accompany the chain of custody. This person will seal the container using packing tape and writing his signature, the time and the date across the tape onto the container with indelible marker. Any time a seal is broken, for whatever purpose, the incident must be recorded on the Chain of Custody (reason, time, and date) in the purpose of transfer block. Container then is resealed using new tape and rewriting signature, with time and date.

EQUIPMENT LIST

Scale or balance of appropriate capacity for the fish to be collected.

Fish measuring board.

Plastic bags of an appropriate size for the fish to be collected and for site bags.

Individually numbered metal tags for fish.

Manila tags to label bags.

Small envelops, approximately 2” x 3.5”, if fish scales are to be collected.

Knife for removing scales.

Chain of custody and fish collection forms.

Clipboard.

Pens or markers.

Paper towels.

Dish soap and brush.

Bucket.

Cooler.

Ice.

Duct tape.

Appendix G – PFAS Analyte List

Group	Chemical Name	Abbreviation	CAS Number
Perfluoroalkyl sulfonates	Perfluorobutanesulfonic acid	PFBS	375-73-5
	Perfluorohexanesulfonic acid	PFHxS	355-46-4
	Perfluoroheptanesulfonic acid	PFHpS	375-92-8
	Perfluorooctanesulfonic acid	PFOS	1763-23-1
	Perfluorodecanesulfonic acid	PFDS	335-77-3
Perfluoroalkyl carboxylates	Perfluorobutanoic acid	PFBA	375-22-4
	Perfluoropentanoic acid	PFPeA	2706-90-3
	Perfluorohexanoic acid	PFHxA	307-24-4
	Perfluoroheptanoic acid	PFHpA	375-85-9
	Perfluorooctanoic acid	PFOA	335-67-1
	Perfluorononanoic acid	PFNA	375-95-1
	Perfluorodecanoic acid	PFDA	335-76-2
	Perfluoroundecanoic acid	PFUA/PFUdA	2058-94-8
	Perfluorododecanoic acid	PFDoA	307-55-1
	Perfluorotridecanoic acid	PFTriA/PFTrDA	72629-94-8
	Perfluorotetradecanoic acid	PFTA/PFTeDA	376-06-7
Fluorinated Telomer Sulfonates	6:2 Fluorotelomer sulfonate	6:2 FTS	27619-97-2
	8:2 Fluorotelomer sulfonate	8:2 FTS	39108-34-4
Perfluorooctane-sulfonamides	Perfluroroctanesulfonamide	FOSA	754-91-6
Perfluorooctane-sulfonamidoacetic acids	N-methyl perfluorooctanesulfonamidoacetic acid	N-MeFOSAA	2355-31-9
	N-ethyl perfluorooctanesulfonamidoacetic acid	N-EtFOSAA	2991-50-6

Appendix H - Laboratory Guidelines for Analysis of PFAS in Non-Potable Water and Solids

General

New York State Department of Environmental Conservation's Division of Environmental Remediation (DER) developed the following guidelines for laboratories analyzing environmental samples for PFAS under DER programs. If laboratories cannot adhere to the following guidelines, they should contact DER's Quality Assurance Officer, Dana Barbarossa, at dana.barbarossa@dec.ny.gov prior to analysis of samples.

Isotope Dilution

Isotope dilution techniques should be utilized for the analysis of PFAS in all media.

Extraction

For water samples, the entire sample bottle should be extracted, and the sample bottle rinsed with appropriate solvent to remove any residual PFAS.

For samples with high particulates, the samples should be handled in one of the following ways:

1. Spike the entire sample bottle with isotope dilution analytes (IDAs) prior to any sample manipulation. The sample can be passed through the SPE and if it clogs, record the volume that passed through.
2. If the sample contains too much sediment to attempt passing it through the SPE cartridge, the sample should be spiked with isotope dilution analytes, centrifuged and decanted.
3. If higher reporting limits are acceptable for the project, the sample can be diluted by taking a representative aliquot of the sample. If isotope dilution analytes will be diluted out of the sample, they can be added after the dilution. The sample should be homogenized prior to taking an aliquot.

If alternate sample extraction procedures are used, please contact the DER remedial program chemist prior to employing. Any deviations in sample preparation procedures should be clearly noted in the case narrative.

Signal to Noise Ratio

For all target analyte ions used for quantification, signal to noise ratio should be 3:1 or greater.

Blanks

There should be no detections in the method blanks above the reporting limits.

Ion Transitions

The ion transitions listed below should be used for the following PFAS:

PFOA	413 > 369
PFOS	499 > 80
PFHxS	399 > 80
PFBS	299 > 80
6:2 FTS	427 > 407
8:2 FTS	527 > 507
N-EtFOSAA	584 > 419
N-MeFOSAA	570 > 419

Branched and Linear Isomers

Standards containing both branched and linear isomers should be used when standards are commercially available. Currently, quantitative standards are available for PFHxS, PFOS, NMeFOSAA, and NEtFOSAA. As more standards become available, they should be incorporated in to the method. All isomer peaks present in the standard should be integrated and the areas summed. Samples should be integrated in the same manner as the standards.

Since a quantitative standard does not exist for branched isomers of PFOA, the instrument should be calibrated using just the linear isomer and a technical (qualitative) PFOA standard should be used to identify the retention time of the branched PFOA isomers in the sample. The total response of PFOA branched and linear isomers should be integrated in the samples and quantitated using the calibration curve of the linear standard.

Secondary Ion Transition Monitoring

Quantifier and qualifier ions should be monitored for all target analytes (PFBA and PFPeA are exceptions). The ratio of quantifier ion response to qualifier ion response should be calculated for each target analyte and the ratio compared to standards. Lab derived criteria should be used to determine if the ratios are acceptable.

Reporting

Detections below the reporting limit should be reported and qualified with a J qualifier.

The acid form of PFAS analytes should be reported. If the salt form of the PFAS was used as a stock standard, the measured mass should be corrected to report the acid form of the analyte.

Appendix I - Data Review Guidelines for Analysis of PFAS in Non-Potable Water and Solids

General

These guidelines are intended to be used for the validation of PFAS analytical results for projects within the Division of Environmental Remediation (DER) as well as aid in the preparation of a data usability summary report. Data reviewers should understand the methodology and techniques utilized in the analysis. Consultation with the end user of the data may be necessary to assist in determining data usability based on the data quality objectives in the Quality Assurance Project Plan. A familiarity with the laboratory's Standard Operating Procedure may also be needed to fully evaluate the data. If you have any questions, please contact DER's Quality Assurance Officer, Dana Barbarossa, at dana.barbarossa@dec.ny.gov.

Preservation and Holding Time

Samples should be preserved with ice to a temperature of less than 6°C upon arrival at the lab. The holding time is 14 days to extraction for aqueous and solid samples. The time from extraction to analysis for aqueous samples is 28 days and 40 days for solids.

Temperature greatly exceeds 6ºC upon arrival at the lab*	Use professional judgement to qualify detects and non-detects as estimated or rejected
Holding time exceeding 28 days to extraction	Use professional judgement to qualify detects and non-detects as estimated or rejected if holding time is grossly exceeded

*Samples that are delivered to the lab immediately after sampling may not meet the thermal preservation guidelines. Samples are considered acceptable if they arrive on ice or an attempt to chill the samples is observed.

Initial Calibration

The initial calibration should contain a minimum of five standards for linear fit and six standards for a quadratic fit. The relative standard deviation (RSD) for a quadratic fit calibration should be less than 20%. Linear fit calibration curves should have an R^2 value greater than 0.990.

The low-level calibration standard should be within 50% - 150% of the true value, and the mid-level calibration standard within 70% - 130% of the true value.

%RSD >20%	J flag detects and UJ non detects
R^2 >0.990	J flag detects and UJ non detects
Low-level calibration check <50% or >150%	J flag detects and UJ non detects
Mid-level calibration check <70% or >130%	J flag detects and UJ non detects

Initial Calibration Verification

An initial calibration verification (ICV) standard should be from a second source (if available). The ICV should be at the same concentration as the mid-level standard of the calibration curve.

ICV recovery <70% or >130%	J flag detects and non-detects

Continuing Calibration Verification

Continuing calibration verification (CCV) checks should be analyzed at a frequency of one per ten field samples. If CCV recovery is very low, where detection of the analyte could be in question, ensure a low level CCV was analyzed and use to determine data quality.

CCV recovery <70 or >130%	J flag results

Blanks

There should be no detections in the method blanks above the reporting limits. Equipment blanks, field blanks, rinse blanks etc. should be evaluated in the same manner as method blanks. Use the most contaminated blank to evaluate the sample results.

Blank Result	Sample Result	Qualification
Any detection	<Reporting limit	Qualify as ND at reporting limit
Any detection	>Reporting Limit and >10x the blank result	No qualification
>Reporting limit	>Reporting limit and <10x blank result	J+ biased high

Field Duplicates

A blind field duplicate should be collected at rate of one per twenty samples. The relative percent difference (RPD) should be less than 30% for analyte concentrations greater than two times the reporting limit. Use the higher result for final reporting.

RPD >30%	Apply J qualifier to parent sample

Lab Control Spike

Lab control spikes should be analyzed with each extraction batch or one for every twenty samples. In the absence of lab derived criteria, use 70% - 130% recovery criteria to evaluate the data.

Recovery <70% or >130% (lab derived criteria can also be used)	Apply J qualifier to detects and UJ qualifier to non detects

Matrix Spike/Matrix Spike Duplicate

One matrix spike and matrix spike duplicate should be collected at a rate of one per twenty samples. Use professional judgement to reject results based on out of control MS/MSD recoveries.

Recovery <70% or >130% (lab derived criteria can also be used)	Apply J qualifier to detects and UJ qualifier to non detects of parent sample only
RPD >30%	Apply J qualifier to detects and UJ qualifier to non detects of parent sample only

Extracted Internal Standards (Isotope Dilution Analytes)

Problematic analytes (e.g. PFBA, PFPeA, fluorotelomer sulfonates) can have wider recoveries without qualification. Qualify corresponding native compounds with a J flag if outside of the range.

Recovery <50% or >150%	Apply J qualifier
Recovery <25% or >150% for poor responding analytes	Apply J qualifier
Isotope Dilution Analyte (IDA) Recovery <10%	Reject results

Secondary Ion Transition Monitoring

Quantifier and qualifier ions should be monitored for all target analytes (PFBA and PFPeA are exceptions). The ratio of quantifier ion response to qualifier ion response should be calculated from the standards for each target analyte. Lab derived criteria should be used to determine if the ratios are acceptable. If the ratios fall outside of the laboratory criteria, qualify results as an estimated maximum concentration.

Signal to Noise Ratio

The signal to noise ratio for the quantifier ion should be at least 3:1. If the ratio is less than 3:1, the peak is discernable from the baseline noise and symmetrical, the result can be reported. If the peak appears to be baseline noise and/or the shape is irregular, qualify the result as tentatively identified.

Branched and Linear Isomers

Observed branched isomers in the sample that do not have a qualitative or quantitative standard should be noted and the analyte should be qualified as biased low in the final data review summary report. Note: The branched isomer peak should also be present in the secondary ion transition.

Reporting Limits

If project-specific reporting limits were not met, please indicate that in the report along with the reason (e.g. over dilution, dilution for non-target analytes, high sediment in aqueous samples).

Peak Integrations

Target analyte peaks should be integrated properly and consistently when compared to standards. Ensure branched isomer peaks are included for PFAS where standards are available. Inconsistencies should be brought to the attention of the laboratory or identified in the data review summary report.

ATTACHMENT 3

Laboratory Standard Operating Procedures and Certifications

Title: Per- and Poly-fluorinated Substances (PFAS) in Water, Soils, Sediments and Tissue

[Method 537 (Modified), PFAS by LCMSMS]

Approvals (Signature/Date):

09/28/2020	09/28/2020
Don Dawicki Date	Ryan Hammond Date
Laboratory Director	Operations Manager / EHS Coordinator
09/28/2020	09/28/2020
Kristine Dusablon Date	Mark Fausel Date
Quality Assurance Manager / Technical Manager	Department Supervisor

Copyright Information:
This documentation has been prepared by TestAmerica Laboratories, Inc. d/b/a Eurofins TestAmerica and its affiliates ("Eurofins TestAmerica"), solely for their own use and the use of their customers in evaluating their qualifications and capabilities in connection with a particular project. The user of this document agrees by its acceptance to return it to Eurofins TestAmerica upon request and not to reproduce, copy, lend, or otherwise disclose its contents, directly or indirectly, and not to use it for any purpose other than that for which it was specifically provided. The user also agrees not to give access to this document to any third parties including but not limited to consultants, unless such third parties specifically agree to these conditions.

THIS DOCUMENT CONTAINS VALUABLE CONFIDENTIAL AND PROPRIETARY INFORMATION. DISCLOSURE, USE OR REPRODUCTION OF THESE MATERIALS WITHOUT THE WRITTEN AUTHORIZATION OF EUROFINS TESTAMERICA IS STRICTLY PROHIBITED. THIS UNPUBLISHED WORK BY EUROFINS TESTAMERICA IS PROTECTED BY STATE AND FEDERAL LAW OF THE UNITED STATES. IF PUBLICATION OF THIS WORK SHOULD OCCUR THE FOLLOWING NOTICE SHALL APPLY:

©COPYRIGHT 2020 TESTAMERICA LABORATORIES, INC. d/b/a EUROFINS TESTAMERICA ALL RIGHTS RESERVED

Facility Distribution No. Electronic **Distributed To: Facility Intranet**

1.0 Scope and Application

This SOP describes the laboratory procedure for the preparation and analysis of per- and polyfluorinated substances using liquid chromatography/tandem mass spectrometry (LC/MS/MS).

Program specific requirements are not included in this SOP. The details of program specific requirements are specified in other laboratory work instructions relevant to the program.

1.1 Analytes, Matrices, and Reporting Limits

This procedure is amenable with water, soil, sediment and tissue sample matrices.
The list of target compounds that may be determined from this procedure is provided below. Table 1 presents the compounds along with their associated reporting limits (RL).

Compound Name	Abbreviation	CAS #
Perfluoroalkylcarboxylic acids (PFCAs)		
Perfluoro-n-butanoic acid (Perfluoro-n-butyric acid)	PFBA	375-22-4
Perfluoro-n-pentanoic acid	PFPeA	2706-90-3
Perfluoro-n-hexanoic acid	PFHxA	307-24-4
Perfluoro-n-heptanoic acid	PFHpA	375-85-9
Perfluoro-n-octanoic acid	PFOA	335-67-1
Perfluoro-n-nonanoic acid	PFNA	375-95-1
Perfluoro-n-decanoic acid	PFDA	335-76-2
Perfluoro-n-undecanoic acid	PFUdA (PFUnA)	2058-94-8
Perfluoro-n-dodecanoic acid	PFDoA	307-55-1
Perfluoro-n-tridecanoic acid	PFTrDA	72629-94-8
Perfluoro-n-tetradecanoic acid	PFTeDA (PFTA)	376-06-7
Perfluoro-n-hexadecanoic acid	PFHxDA	67905-19-5
Perfluoro-n-octadecanoic acid	PFODA	16517-11-6
Perfluorinated sulfonic acids (PFSAs)		
Perfluoro-1-butanesulfonic acid	PFBS	375-73-5
* Perfluoro-1-pentanesulfonic acid	PFPeS	2706-91-4
Perfluoro-1-hexanesulfonic acid	PFHxS	355-46-4
Perfluoro-1-heptanesulfonic acid	PFHpS	375-92-8
Perfluoro-1-octanesulfonic acid	PFOS	1763-23-1
* Perfluoro-1-nonanesulfonic acid	PFNS	68259-12-1
Perfluoro-1-decanesulfonic acid	PFDS	335-77-3
Perfluorododecanesulfonic acid	PFDoS	79780-39-5
Perfluorinated sulfonamides (FOSA)		
Perfluoro-1-octanesulfonamide	FOSA	754-91-6
Perfluorinated sulfonamidoacetic acids (FOSAA)		
N-ethylperfluoro-1-octanesulfonamidoacetic acid	EtFOSAA	2991-50-6
N-methylperfluoro-1-octanesulfonamidoacetic acid	MeFOSAA	2355-31-9
Fluorotelomer sulfonates (FTS)		
* 1H,1H,2H,2H-perfluorohexanesulfonic acid *(4:2)*	4:2 FTS	757124-72-4
1H,1H,2H,2H-perfluorooctanesulfonic acid *(6:2)*	6:2 FTS	27619-97-2

1H,1H,2H,2H-perfluorodecanesulfonic acid *(8:2)*	8:2 FTS	39108-34-4
1H,1H,2H,2H-perfluorododecane sulfonic acid (10:2)	10:2 FTS	120226-60-0
Fluorinated Replacement Chemicals		
Hexafluoropropylene oxide dimer acid	HFPO-DA	13252-13-6
4,8-dioxa-3H-perfluorononanoic acid	DONA	919005-14-4
9-chlorohexadecafluoro-3-oxanonane-1-sulfonic acid	F53B Major (9Cl-PF3ONS)	756426-58-1
11-chloroeicosafluoro-3-oxaundecane-1-sulfonic acid	F53B Minor (11Cl-PF3OUdS)	763051-58-1

Abbreviations in parenthesis are the abbreviations listed in Method 537, where they differ from the abbreviation used by the laboratory's LIMS.
***Indicates the analyte is not certified in any state or program.**
Note: Analytes with secondary certification in NJDEP can be found in Appendix D and samples collected in New Jersey are only approved for non-potable water.

The working range of the method is listed below. The linear range can be extended by diluting the extracts.

Matrix	Nominal Sample Size	Reporting Limit	Working Range
Water	250 mL	2.0 ng/L - 5 ng/L	2.0 ng/L - 400 ng/L
Soil/Sediment	5 g	0.2 µg/Kg–0.5 µg/Kg	0.2 µg/Kg-40 µgKg
Tissue	1 g	1.0 µg/Kg–10 µg/Kg	1.0 µg/Kg–200 µg/Kg

On occasion clients may request modifications to this SOP. These modifications are handled following the procedures outlined in the Quality Assurance Manual.

2.0 Summary of Method

Water Samples: Water samples are extracted using a solid phase extraction (SPE) cartridge. PFAS are eluted from the cartridge with an [redacted] solution.

Soil/sediment/tissue samples are extracted with a [redacted] solution using a TCLP tumbler operating at [redacted]. The mixture is centrifuged to reduce the amount of solid transferred when decanting the solvent. The solvent extract is exchanged to water using nitrogen blowdown, then the aqueous extract is extracted using a solid phase extraction (SPE) cartridge. PFAS are eluted from the cartridge with an ammonium hydroxide/methanol solution.

The final [redacted] extracts are analyzed by LC/MS/MS operated in electrospray (ESI) negative ion mode. PFAS are separated from other components on a C18 column with a solvent gradient program [redacted] and methanol.

An isotope dilution technique is employed with this method for the compounds of interest. The isotope dilution analytes (IDAs) consist of carbon-13 labeled analogs, oxygen-18 labeled analogs, or deuterated analogs of the compound of interest, and they are spiked into the samples at the time of extraction. This technique allows for the correction for analytical bias encountered when analyzing more chemically complex environmental samples. The isotopically labeled compounds are chemically similar to the compounds of concern and are therefore affected by sample-related interferences to the same extent as the compounds of concern. Compounds that do not have an

identically labeled analog are quantified by the IDA method using a closely related labeled analog.

Quantitation by the internal standard method is employed for the IDA analytes/recoveries. Peak response is measured as the area of the peak.

This SOP is based on the following reference methods:

- US EPA, "Method 537 - Determination of Selected Perfluorinated alkyl acids in Drinking Water by Solid Phase Extraction and Liquid Chromatography/Tandem Mass Spectrometery (LC/MS/MS)", Version 1.1, September 2009.
- Method ISO 25101, "Water quality – Determination of perfluorooctanesulfonate (PFOS) and perfluorooctanoate (PFOA) – Method for unfiltered samples using solid phase extraction and liquid chromatography/mass spectrometry", First Edition, 2009-03-01, International Organization for Standardization, Technical Committee ISO/TC 147, Water Quality, Subcommittee SC 2, Physical, chemical and biochemical methods.

If the laboratory's SOP is modified from the reference method, a list of method modifications along with technical justification may be found in Section 16. Modifications to this SOP may be applied on a project specific basis to meet project data quality objectives. Project specific modifications are documented in the project record.

3.0 Definitions

Refer to the Laboratory's Quality Assurance Manual (QAM) for the Glossary of Terms, Definitions and Acronyms except as follows.

Definitions of terms used in this SOP may be found in Appendix A.

4.0 Interferences

PFAS have been used in a wide variety of manufacturing processes, and laboratory supplies should be considered potentially contaminated until they have been tested and shown to be otherwise. The materials and supplies used during the method validation process have been tested and shown to be clean. These items are listed below in Section 6.

To avoid contamination of samples, standards are prepared in a ventilation hood in an area separate from where samples are extracted.

PTFE products can be a source of PFOA contamination. The use of PTFE in the procedure should be avoided or at least thoroughly tested before use. Polypropylene (PP) or polyethylene (PE, HDPE) products may be used in place of PTFE products to minimize PFOA contamination.

Standards and samples are injected from polypropylene autosampler vials with polyethylene screw caps once. Multiple injections may be performed on Primers when conditioning the instrument for analysis.

Random evaporation losses have been observed with the polyethylene caps causing high IDA recovery after the vial was punctured and sample re-injected. For this reason, it is best to inject standards and samples once in the analytical sequence.

Teflon-lined screw caps have detected PFAS at low concentrations. Repeated injection from the

same Teflon-lined screw cap have detected PFNA at increasing concentration as each repeated injection was performed, therefore, it is best to use polyethylene screw caps.

Volumetric glassware and syringes are difficult to clean after being used for solutions containing high levels of PFAS. These items should be labeled for use only with similarly concentrated solutions or verified clean prior to re-use. To the extent possible, disposable labware is used.

Both branched and linear isomers of PFOS, PFOA, PFHxS, PFBS, EtFOSAA and MeFOSAA can potentially be found in the environment, based upon scientific literature. If multiple isomers are present for one of these PFAS, these adjacent peaks are either completely resolved or not resolved but with a profound deflection that can be resolved during peak integration. The later of the peaks matches the retention time of the single labeled PFAS peak. In general, earlier peaks are branched isomers and are not a result of peak splitting, and all the chromatographic peaks observed in the standard and/or sample must be integrated and the areas included.

When reference standards of technical mixtures of specific PFAS area available, they should be used to ensure that all appropriate peaks are included during peak integration (at this time, only PFOS, PFOA, PFHxS, EtFOSAA and MeFOSAA are available as technical mixtures). Refer to Section 7, Reagents, for the available technical mixtures utilized by this SOP.

In an attempt to reduce PFOS bias, it is required that m/z 449>80 transition be used as the quantitation transition.

Per the Certificate of Analysis for labeled perfluorohexadecanoic acid (13C2-PFHxDA) produced by Wellington Laboratories, the stock standard contains roughly 0.3% of native perfluorohexadecanoic acid. The laboratory utilizes a weighted linear regression that is not forced through the origin for the calibration of native perfluorohexadecanoic acid to account for this contribution from its labeled IDA.

5.0 Safety

Employees must abide by the policies and procedures in the NDSC Eurofins TestAmerica Laboratories Environmental Health and Safety Manual (CW-E-M-001), and this document. This procedure may involve hazardous material, operations and equipment. This SOP does not purport to address all of the safety problems associated with its use. It is the responsibility of the user of the method to follow appropriate safety, waste disposal and health practices under the assumption that all samples and reagents are potentially hazardous. Safety glasses, gloves, lab coats and closed-toe, nonabsorbent shoes are a minimum.

5.1 Specific Safety Concerns or Requirements

Preliminary toxicity studies indicate that PFAS could have significant toxic effects. In the interest of keeping exposure levels as low as reasonably achievable, PFAS must be handled in the laboratory as hazardous and toxic chemicals.

Exercise caution when using syringes with attached filter disc assemblies. Application of excessive force has, upon occasion, caused a filter disc to burst during the process.

Laboratory procedures such as the use of pipets and transferring of extracts represent a significant potential for repetitive motion or other ergonomic injuries. Laboratory associates performing these procedures are in the best position to realize when they are at risk for these types of injuries. Whenever a situation is found in which an employee is performing the same

repetitive motion, the employee shall immediately bring this to the attention of their supervisor, manager or the EH&S staff. The task will be analyzed to determine a better means of accomplishing it.

Eye protection that satisfies ANSI Z87.1 (as per the Eurofins TestAmerica Corporate Safety Manual), a laboratory coat and nitrile gloves must be worn while handling samples, standards, solvents and reagents. Disposable gloves that have been contaminated will be removed and discarded; other gloves will be cleaned immediately.

Perfluorocarboxylic acids are acids and are not compatible with strong bases.

The use of vacuum systems presents the risk of imploding glassware. All glassware used during vacuum operations must be thoroughly inspected prior to each use. Glass that is chipped, scratched, cracked, rubbed or marred in any manner must not be used under vacuum. It must be removed from service and replaced.

The HPLC and MS/MS have areas of high voltage. Depending on the type of work involved, the instrument should be turned off or disconnected from its source of power prior to extensive maintenance.

5.2 Primary Materials Used

Table 2 lists those materials used in this procedure that have a serious or significant hazard rating along with the exposure limits and primary hazards associated with that material as identified in the SDS. **NOTE: This list does not include all materials used in the method.** A complete list of materials used in the method can be found in the reagents and materials section. Employees must review the information in the SDS for each material before using it for the first time or when there are major changes to the SDS.

6.0 Equipment and Supplies

Catalog numbers listed in this SOP are subject to change at the discretion of the vendor. Analysts are cautioned to be sure equipment used meets the specification of this SOP.

6.1 Miscellaneous

- 15 mL polypropylene test tubes with screw caps, Fisherbrand 05-539-5 or equivalent.
- 250-mL HDPE wide-mouth bottles with screw caps (ESS 0250-1901-).
- Analytical balance capable of weighing to the nearest 0.01g, and checked for accuracy each day it is used in accordance with BR-GT-008.
- SPE Vacuum manifold, 24-port, [redacted] or equivalent.
- 1/8” OD Poly siphon lines, 30” long for sample loading.
- SPE Adaptor Caps for 1, 3, and 6 mL SPE Tubes, Polyethylene, [redacted] or equivalent.
- SPE Stopcocks, Polyethylene and Polypropylene, [redacted] or equivalent.
- Stainless steel solvent guide needles, [redacted], or equivalent.
- Heavy-Wall filter flask, Fisherbrand 4000mL, [redacted] or equivalent.
- TCLP tumbler, [redacted] for extraction of soil, sediment and tissue samples.
- Glass-Col ZipVap 24-port extract concentrator.

- Polypropylene Syringe, 10 mL with luer-lok or luer slip tips, [redacted] or equivalent.
- Volumetric Syringes, Class "A" (25µL, 50µL 100µL, and 500µL), Hamilton or equivalent.
- Automatic Pipettor, Finnpette, 1-5mL.
- Polypropylene autosampler vials, 300µL, 700µL and 2mL with polyethylene screw caps.
- Waters Oasis [redacted] or equivalent, for the extraction of PFAS from aqueous samples.
- Waters Oasis [redacted] or equivalent, for the cleanup of soils.
- 250mL Poly bottles containing 1.25g of Trizma Pre-Set Crystals, used for batch QC for samples received with Trizma preservation.
- 50mL graduated polypropylene centrifuge tubes. [redacted] or equivalent.
- 500ml Polyethylene wash bottle
- 4, 6, and 12ml Class A Volumetric Pipette
- Graphitized carbon (Envi-Carb™ or equivalent)
- Miscellaneous laboratory apparatus (beakers, test tubes, volumetric flasks, pipettes, etc). These should be disposable wherever possible, or marked and segregated for high-level versus low-level use.

6.2 Analytical System

Liquid Chromatography/Tandem Mass Spectrometer (LC/MS/MS)-as described below. The use of a column heater is required to maintain a stable temperature throughout the analytical run. Data is processed using Chrom Peak Review, version 2.1 or equivalent.

- SCIEX LC/MS/MS
  This system consists of a [redacted] HPLC interfaced with a [redacted] The instrument control and data acquisition software is [redacted] equivalent.

  [redacted] HPLC equipped with [redacted] and one [redacted] or equivalent. [redacted] Column Oven.

  [redacted] or equivalent.

  PFAS Isolator column. [redacted]. These are plumbed between the pump's mixing valve and the autosampler to minimized the HPLC-based PFAS background from injection-based PFAS.

7.0 Reagents and Standards

7.1 Reagents

All reagents must follow traceability guidelines found in SOP BR-QA-002.

- Ammonium acetate Stock Solution, [redacted]
- [redacted] ammonium acetate eluent.. [redacted]

- Ammonium hydroxide, concentrated, JT Baker or equivalent.
- Ammonium hydroxide (NH_4OH) [redacted] of Methanol. Volume prepared may be adjusted based on usage/need.
- Potassium hydroxide pellets, 87% purity, JT Baker P250-1 or equivalent.
- Potassium hydroxide (KOH), [redacted]
- Reagent Water, house reverse-osmosis reagent water ("PFAS-Free" via in-house testing).
- Hexane, Ultra-Resi Analyzed, JT Baker or equivalent.
- Methanol, HPLC JT Baker or equivalent.
- Sodium hydroxide, pellets, JT Baker or equivalent.
- Sodium hydroxide (NaOH), [redacted]
- Acetonitrile, Optima Grade, Fisherbrand or equivalent.

7.2 Standards

Purchase high purity, technical grade solids (96% or greater) or certified solutions from commercial vendors. Standard materials are verified compared to a second source material at the time of initial calibration. The solid stock material is stored at room temperature or as specified by the manufacturer or vendor. If solid material is used for preparing a standard, stock standard solutions are prepared from the solids and are stored at 4 ± 2°C. Stock standard solutions should be brought to room temperature before using. Standards are monitored for signs of degradation or evaporation. Standard solutions must be replaced at least annually from the date of preparation.

Per the Certificate of Analysis for labeled perfluorohexadecanoic acid (13C2-PFHxDA) produced by Wellington Laboratories, the stock standard contains ~0.3% of native PFHxDA. This equates to roughly 0.30 ng/L or 0.015 ug/Kg of PFHxDA expected in all samples and blanks.

As of this writing, only PFOS, PFOA, PFHxS, MeFOSAA and EtFOSAA are commercially available as technical mixtures. These reference standards of the technical mixtures for these specific PFAS are used to ensure that all appropriate peaks are included during peak integration.

PFBS, PFHxS, PFHpS, PFOS, PFDS, and many other PFAS are not available in the acid form, but rather as their corresponding salts, such as sodium or potassium. The standards are prepared and corrected for their salt content according to the equation below.

$$Mass_{acid} = Measured\ Mass_{salt} \times MW_{acid} / MW_{salt}$$

Where: MW_{acid} is the molecular weight of PFAA

MW_{salt} is the molecular weight of the purchased salt.

For example, the molecular weight of PFOS is 500.1295 and the molecular weight of NaPFOS is 523.1193. Therefore, the amount of NaPFOS used must be multiplied by a factor of 0.956 to account for the amount of PFOS in the final solution.

While PFAS standards commercially purchased are supplied in glass ampoules, all subsequent transfers or dilutions performed by the analyst must be prepared and stored in polypropylene or HDPE containers.

Prepare calibration and working standards by diluting a known volume of stock standard in an appropriate solvent to the final volume needed to achieve the desired concentration. The

recommended formulation for each standard used in this procedure is provided in Appendix B along with the recommended source materials, expiration dates and storage conditions.

A technical (qualitative) grade PFOA standard is analyzed initially, then after initial calibration when a new column is installed or when significant changes are made to the HPLC parameters. This solution is used as a reference for the PFOA isomers (branched and linear) retention times.

A second source solution for PFAS is purchased from the same vendor; the PFC-MXB contains most of the target analytes in this mixture and is used as an ICV. For those compounds not available in this mixture or are not available from another vendor, a second analyst may prepare a second source standard from the same source as the ICAL to produce an ICV. The recommended concentration of the ICV standard should be in the mid-range of the calibration curve. The concentration may be adjusted if the initial calibration levels are changed or altered. The IDA and ISTD are added at a fixed concentration (2.5 ng/mL in extract).

7.3 Extraction Spiking Solutions

PFAS LCS/Matrix Spike Solution, 400 ng/mL

The PFAS spike solution is prepared by diluting all PFAS to produce a solution containing each PFAS at a concentration of 400 ng/mL in methanol.

PFAS High Level LCS Solution, 1000 ng/mL

The PFAS spike solution is prepared by diluting all PFAS to produce a solution containing each PFAS at a concentration of 1000 ng/mL in methanol.

PFAS Isotope Dilution Analyte Solution, 500 ng/mL

The PFAS-IDA solution is prepared by diluting all labeled PFAS to produce a solution containing each IDA compound at a concentration of 1000 ng/mL in methanol.

Internal Standard Solution, $^{13}C_2$-PFOA, 1250 ng/mL

The internal standard solution is prepared by diluting the stock 50 µg/mL $^{13}C_2$-PFOA 20-fold in methanol.

See Appendix B for analyte lists and concentrations.

8.0 Sample Collection, Preservation, Shipment and Storage

The laboratory does not perform sample collection so these procedures are not included in this SOP, sampling requirements may be found in the published reference method.

Sample container, preservation techniques and holding times may vary and are dependent on sample matrix, method of choice, regulatory compliance, and/or specific contract or client requests. Listed below are the holding times and the references that include preservation requirements.

Matrix	Sample Container	Minimum Sample Size	Preservation	Holding Time[1]	Reference
Water	250 mL HDPE Bottle	250 mL	0-6°C, Trizma (5g/L) (if from a known	14 days from collection	Method 537

			chlorinated source)		
Soil/Sediment	4/8 oz HDPE wide-mouth container	100 g	0-6°C	14 days from collection	SW-846 Organic Methods
Extract	700 µL Polypropylene (PP) Vial with HDPE Screw cap	NA	0-6°C	40 days from extraction (28 days from extraction for samples collected in NJ)	NJDEP guidance

[1]*Extraction holding time is calculated from date of collection. Analytical holding time is determined from date of extraction.*

Unless otherwise specified by client or regulatory program, after analysis, samples and extracts are retained for a minimum of 30 days after provision of the project report and then disposed of in accordance with applicable regulations.

9.0 Quality Control

Sample QC

When samples contain the preservative Trizma, all associated QC must be treated with the same preservative.

Initial Demonstration of Capability (IDOC) and Method Detection Limit (MDL) studies described in Section 12 must be acceptable before analysis of samples may begin.

Batches are defined at the sample preparation step. Batches should be kept together through the whole analytical process as far as possible, but it is not mandatory to analyze prepared extracts on the same instrument or in the same sequence.

The laboratory prepares the following sample QC for each extraction batch (an extraction batch is limited to a maximum of 20 field samples of the same matrix processed using the same procedure and reagents within the same time period):

QC Item	Frequency	Acceptance Criteria
Method Blank (MB)	1 per extraction batch	See Table 3
Laboratory Control Sample (LCS)	1 per extraction batch (Spiking Level rotates between Low, Medium and High on a batch-by-batch basis)	See Table 3
LCS Duplicate (LCSD)	1 per extraction batch whenever insufficient sample is available for an MS/MSD/DU	See Table 3
*Matrix Spike (MS/MSD)	1 per extraction batch (if sufficient sample is available)	See Table 3
*Sample Duplicate (SD)	DW-1 per extraction batch (if sufficient sample is available); Non-DW matrices- client request	See Table 3

	if sufficient sample is available	
Field Reagent Blank, FRB	Per client set of samples	See Table 3

*An NCM must be applied if there is insufficient volume for a MS/MSD or duplicate.

Instrument QC

The following instrument QC is performed:

QC Item	Frequency	Acceptance Criteria
Initial Calibration (ICAL)	Initially, when CCV fails and after major instrument maintenance	See Table 3
Initial Calibration Blank (ICB)	Immediately after ICAL	See Table 3
Second Source Verification (ICV)	Immediately after ICB	See Table 3
Continuing Calibration Verification (CCV)	Beginning, end and after every 10 field samples. Alternate between ICAL Levels 4 and 5 (in order) throughout sequence	See Table 3
Continuing Calibration Verification Low (CCVL)	Immediately prior to Level 4 CCV at beginning of every non-ICAL analytical sequence	See Table 3
Isotope Dilution Analytes (IDA)	Added to Every injection (Standards, QC and Field Samples) at the same concentration	See Table 3

10.0 Procedure

One-time procedural variations are allowed only if deemed necessary in the professional judgment of a supervisor to accommodate variation in sample matrix, chemistry, sample size, or other parameters. Any variation in procedure shall be completely documented using a Non-Conformance Memo (NCM). The NCM process is described in more detail in SOP BR-QA-016. The NCM shall be filed in the project file and addressed in the case narrative. ***Any deviations from this procedure identified after the work has been completed must be documented in an NCM, with a cause and corrective action described.***

10.1 Water Sample Preparation

Visually inspect samples for the presence of settled and/or suspended sediment. If the amount of sediment is so great that the SPE cartridge will clog before the majority of the sample has eluted, filter the water sample through a glass fiber filter [redacted] or equivalent). Gravity or vacuum can be used to pass the sample through the filter. Prepare a filtration blank and LCS with any samples requiring filtration. File an NCM noting the need for filtration.

> Warning: The use of a vacuum system creates the risk of glassware implosion. Inspect all glassware prior to use. Glassware with chips, scratches, rub marks or cracks must not be used.

Due to the high surface activity of the analytes, filtration should be regarded as a last resort. All samples will be spiked with IDA prior to filtration (if enough sample is available, perform an MS on each sample); this will allow any losses caused by filtration to be monitored and corrected for.

NOTE: for samples which full volume extraction is not possible, care MUST be taken to ensure the actual sample volume that is both spiked and extracted are documented in the sample worksheet notes.

Prepare two 250 mL aliquots of HPLC-grade water for the method blank and LCS.

Rotate the LCS concentration with each batch.

-Low Level LCS (50-150 %R), spike with 0.50 mL of PFAS LOQV solution. This will result in sample concentrations at the method Reporting Limit.

-Medium Level LCS (70-130 %R), spike with 0.025 mL (25 µL) of the PFAS LCS/Matrix Spike solution (Section 7.2). This will result in a sample concentration of 40 ng/L.

-High level LCS (70-130 %R), spike at 0.05mL (50uL) of the PFAS High Level LCS Spike solution (Section 7.2). This will result in a sample concentration of 200 ng/L.

Spike the MS/MSD (if available volume) with 0.025 mL (25 µL) of the PFAS LCS/Matrix Spike solution (Section 7.2). This will result in a sample concentration of 40 ng/L. NCM if there is insufficient volume to perform the MS/MSD.

Add [redacted] of the PFAS-IDA solution (Section 7.2) into each sample and QC sample, for a fixed concentration of 1.25 ng/mL in extract.

Due to the surface active nature of the PFAS analytes, it is necessary to extract the entire sample as well as the container walls to maximize recovery. It is therefore ideal to receive full 250 mL HDPE bottles for each sample (and MS/MSD if sufficient volume is received) so the entire sample can be processed from that container.

Weigh each container to determine its pre-extraction mass (Gross Weight). Spike each container in the batch with PFAS-IDA solution. Spike the LCS and LCSD (or MS/MSD, if available volume) with PFAS LCS/Matrix solution. Shake to mix the contents. After the extraction has been completed, allow the container to completely dry (uncapped). Replace the cap and reweigh the container to determine the container mass (Tare Weight). The sample volume extracted can be determined by subtracting the Tare Weight from the Gross Weight. These calculations are captured in the PFAS water sample prep module (TALS Method 3535_IVWT and 25101_2009_SPE).

10.1.1 Solid Phase Extraction (SPE) of Aqueous Samples

Condition the SPE cartridges [redacted] by passing the following without drying the column.

> **WARNING: The use of a vacuum system creates the risk of glassware implosion. Inspect all glassware prior to use. Glassware with chips, scratches, rub marks or cracks must not be used.**

Wash with 5.0 mL of [redacted]

Wash with 5.0 mL of [redacted] Close valve when ~ 1 mL remains on top to keep column wet. After this step, the columns should not go dry until the completion of loading and rinsing samples.

Appropriately label the SPE cartridges.

Add a poly siphon line to an adapter which has been firmly inserted into the SPE cartridge and place the other end of the line into the corresponding sample container.

Turn on the vacuum and pull the entire sample volume (minimum of 250 mL) through the cartridge at rate of approximately [redacted]

Stop the sample elution when ~0.1 mL remains. Add ~5 mL of water to the SPE column and restart the elution to complete the loading process. The added water volume ensures there are no small sample droplets remaining that may be clinging to the wall of the SPE cartridge.

After the sample and water rinse has passed through the cartridge, allow the cartridge to completely dry with vacuum (this could take up to 90 minutes). The cartridge should return to a uniform color. NOTE: Remove and replace each cartridge during the drying process to ensure any water droplets that may be in the flow path are eliminated.

10.1.2 SPE Column Wash of Aqueous Samples with Hexane

Add [redacted] to each SPE column and let the column become fully saturated with solvent. Close the stopcock and allow the column to soak for five minutes, then elute to waste.

Load a second [redacted] and elute to waste (without a soaking period).

Allow the column to dry with vacuum for 5 to 10 minutes. Columns must be dried thoroughly before continuing. The cartridge should return to a uniform color. Wipe any remaining water droplets from the bottom of the stainless steel guide needles using a fresh Kimwipe for each needle prior to proceeding to the next step.

10.1.3 SPE Elution of Aqueous Samples

Note: The use of glass should be avoided where able. However, disposable glass pipettes have a much narrower opening, which is necessary to reduce spillage during the following transfer steps.

Place labeled 15 mL polypropylene test tubes containing [redacted] of Reagent Water as receiving tubes in the SPE manifold.

Rinse the dried sample bottles with [redacted] and transfer to the corresponding SPE cartridge using a disposable glass pipet (NOTE: the sample container has molded ridges in the neck that can trap up to 0.5mL of the solvent rinsate; make sure to tip the container slightly to draw the rinsate out of the ridges). Allow the solution to soak the cartridge for 5 minutes and then elute into the 15 mL collection tube.

Repeat the sample bottle rinse to cartridge elution process with a [redacted] (without the soaking period). The total collection should be approximately 10 mL. Adjust to 10 mL with methanol.

10.1.4 Sample Cleanup with Graphitized Carbon (Optional)

Note: If this step is to be performed, do not add the [redacted] to the receiving tubes prior to extract collection. Add [redacted] of graphitized carbon to each sample extract and QC extracts to aid in the removal of organic interferences. Shake vigorously and then let sit for 10 minutes. Centrifuge each sample for 2 minutes at 1000 rpm. Decant the solvent layer into a new 15mL centrifuge tube containing 2 mL of Reagent Water and swirl to mix. Adjust the volume to 10 mL with methanol.

10.1.5 Internal Standard Addition

Add [redacted] internal standard to each extract and vortex to mix well.

Transfer a portion of the extract to a labeled 300µL polypropylene autosampler vial (6 drops or approximately 60µL). Archive the rest of the extract in the event the sample needs re-injection and/or dilution.

Seal the vials with polyethylene screw caps. Note: Teflon lined caps may not be used due to detection of low level concentration of PFAS.

10.2 Soil Sample Preparation

Visually inspect soil samples for homogeneity. Weigh a representative 5 g aliquot of soil, sediment or 1 g of tissue sample into a 50 mL centrifuge tube. Weigh additional sample amounts for the matrix spike and matrix spike duplicate analyses if they are requested and enough sample mass is available. Weigh 5 g aliquots of Ottawa sand or 0.1 g of oil for the MB and LCS samples.

Spike the LCS and MS/MSD (if requested) with 25 µL LCS/Matrix Spike Solution. This will result in a sample concentration of 2.0 ng/g (1.0 ng/mL ext).

Add [redacted] of IDA PFC Spiking Solution into each sample and QC sample, for a fixed concentration of 1.25 ng/mL in the final sample vial.

Cap the sample tubes and allow the spikes to settle into the sample matrix. Gently shake the bottles to mix the spike into the matrix.

Add [redacted] to each sample. Cap each sample and shake lightly to confirm container is sealed.

Place all samples in the prep batch into the TCLP tumbler and tumble for 3 hours.

After removing the samples from the tumbler, gently shake each container to confirm the solid material has settled to the bottom of the centrifuge tube, then place in a sonic bath for 12 hours.

Centrifuge each sample at 3500 rpm for 15 minutes.

Transfer the supernate (solvent) to a second, labeled 50 mL centrifuge tube containing 2 mL of Reagent Water.

Slowly add [redacted] to original 50 mL extraction tube. Pour the 2 mL of solvent rinse into the second labeled tube to complete the quantitative transfer.

Place extracts in the ZipVap set to 60 C for ~3 hours with nitrogen flow just strong enough to gently ripple the surface of the extracts. The concentration step is complete when the final volume either gets below 2 mL or maintains at the same level after consecutive checks a 5 minute intervals (this may be due to sample-based moisture contributing to the amount of water in the extract). Remove the sample from the ZipVap when the concentration has completed and allow the extracts to cool.

Adjust the volume of each sample's extract to 15 mL with Reagent Water and add 75 uL of Glacial Acetic Acid to neutralize the solution to pH 6-8. If the extracts contain suspended solids, centrifuge them at 3500 rpm for 15 minutes.

10.2.1 Solid Extract Cleanup by SPE

Condition the SPE cartridges [redacted] by passing the following without drying the column.

Wash with [redacted] with [redacted] Wash with a second [redacted] followed by a second [redacted] Close valve when ~ 0.5 mL remains on top to keep column wet. After this step, the columns should not go dry until the completion of loading and rinsing samples.

Appropriately label the SPE cartridges.

Pour each aqueous sample extract into its corresponding SPE cartridge until it is filled. Turn on the vacuum and open the stopcock to load the sample onto the cartridge. Add the remaining extract to the cartridge before it goes dry and stop the flow just before all of the sample has been drawn into the media. [redacted] 50 mL centrifuge tube to rinse the tube and complete the quantitative transfer. Pour this rinse into the SPE cartridge and open the stopcock to load the rest of the rinsate onto the cartridge. The added water volume ensures there are no small sample droplets remaining that may be clinging to the wall of the SPE cartridge. Set the centrifuge tubes aside and allow them to completely dry.

After the sample and water rinse has passed through the cartridge, allow the cartridge to completely dry with vacuum (this could take up to 30 minutes). The cartridge should return to a uniform color. NOTE: Remove and replace each cartridge during the drying process to ensure any water droplets that may be in the flow path are eliminated.

10.2.2 SPE Column Wash of Solid Extracts with Hexane

Add [redacted] of hexane to each SPE column and let the column become fully saturated with solvent. Close the stopcock and allow the column to soak for five minutes, then elute to waste.

Load a second [redacted] of hexane and elute to waste (without a soaking period).

Allow the column to dry with vacuum for 5 to 10 minutes. Columns must be dried thoroughly before continuing. The cartridge should return to a uniform color. Wipe any remaining water droplets from the bottom of the stainless steel guide needles using a fresh Kimwipe for each needle prior to proceeding to the next step.

10.2.3 SPE Elution of Solid Extracts

Place labeled 15 mL polypropylene test tubes containing [redacted] as receiving tubes in the SPE manifold.

Rinse the dried sample tubes [redacted] and transfer to the corresponding SPE cartridge. Allow the solution to soak the cartridge for 5 minutes and then elute into the 15 mL collection tube.

Repeat sample bottle rinse to cartridge elution process with [redacted] (without the soaking period) The total collection should be approximately 10 mL. Adjust to 10 mL

with methanol.

10.2.4 Sample Cleanup with Graphitized Carbon (Optional)

Note: If this step is to be performed, do not add the [redacted] to the receiving tubes prior to extract collection. Add [redacted] of graphitized carbon to each sample extract and QC extracts to aid in the removal of organic interferences. Shake vigorously and then let sit for 10 minutes. Centrifuge each sample for 2 minutes at 1000 rpm. Decant the solvent layer into a new 15mL centrifuge tube containing 2 mL of Reagent Water and swirl to mix. Adjust the volume to 10 mL with methanol.

10.2.5 Internal Standard Addition

Add [redacted] internal standard to each extract and vortex to mix well.

Transfer a portion of the extract to a labeled 300µL polypropylene autosampler vial (6 drops or approximately 60µL). Archive the rest of the extract in the event the sample needs re-injection and/or dilution.

Seal the vials with polyethylene screw caps. Note: Teflon lined caps may not be used due to detection of low level concentration of PFAS.

10.3 Instrument Operating Conditions

Suggested operating conditions are listed below for the [redacted] LCMS system:

Recommended Instrument Operating Conditions					
HPLC Conditions (Shimadzu HPLC)					
Column (Column temp = 45°C)	Phenomenex Gemini C18 3um, 3.0mm x 100mm				
Mobile Phase Composition	A=20mM Ammonium Acetate (90/10 water/methanol) B=Methanol				
Gradient Program	**Time**	**%A**	**%B**	**Curve**	**Flow Rate mL/min.**
	[redacted]			6	0.60
				6	0.60
				6	0.60
				6	0.60
				6	0.60
				6	0.60
	Maximum pressure limit = 5,000 psi				
Injection Size	[redacted]				
Run Time	[redacted]				
Mass Spectrometer Interface Settings (Sciex 5500 QQQ)					
MS Interface Mode	[redacted]				
Ionspray (volts)	[redacted]				
Declustering Potential-DP (volts)	[redacted]				
Entrance Potential-EP (volts)	[redacted]				

Source Temp (TEM)	[redacted]
Curtain Gas (CUR)	[redacted]
Collision Gas (CAD)	[redacted]
Ion Source Gas 1 (GS1)	
Ion Source Gas 2 (GS2)	
Collision Energy-CE (volts)	[redacted]
Collision Cell Exit Potential-CXP (volts)	[redacted]

Recommended Instrument Operating Conditions

Mass Spectrometer Scan Settings [redacted]

Compound	Comments	Reaction (MRM)	Dwell (sec)	DP(v)	EP(v)	CE(v)	CXP(v)
PFBA	Native analyte	212.9 > 169.0	0.011	[redacted]			
13C4 PFBA	IDA	217.0 > 172.0	0.011				
PFPeA	Native analyte	262.9 > 219.0	0.011				
13C5 PFPeA	IDA	267.9 > 223.0	0.011				
PFBS	Native analyte	298.9 > 80.0	0.011				
PFBS_2	Native analyte	298.9 > 99.0	0.011				
13C3 PFBS	IDA	301.9 > 80.0	0.011				
PFHxA	Native analyte	313.0 > 269.0	0.011				
PFHxA_2	Native analyte	313.0 > 119.0	0.011				
13C2 PFHxA	IDA	315.0 > 270.0	0.011				
4:2FTS	Native analyte	327.0 > 307.0	0.011				
M2-4:2FTS	IDA	329.0 > 81.0	0.011				
PFPeS	Native analyte	349.0 > 80.0	0.011				
PFPeS_2	Native analyte	349 > 99.0	0.011				
HFPO-DA	Native analyte	329.1 > 285	0.011				
13C3 HFPO-DA	IDA	332.1 > 287	0.011				
PFHpA	Native analyte	363.0 > 319.0	0.011				
PFHpA_2	Native analyte	363.0 > 169.0	0.011				
13C4 PFHpA	IDA	367.0 > 322.0	0.011				
PFHxS	Native analyte	399.0 > 80.0	0.011				
PFHxS_2	Native analyte	399.0 > 99.0	0.011				
18O2 PFHxS	IDA	403.0 > 84.0	0.011				
DONA	Native analyte	377 > 251	0.011				
DONA_2	Native analyte	377 > 85	0.011				
PFOA	Native analyte	413.0 > 369.0	0.011				
PFOA_2	Native analyte	413.0 > 169.0	0.011				
13C2 PFOA	Internal Std	415.0 > 370.0	0.011				
13C4 PFOA	IDA	417.0 > 372.0	0.011				
6:2FTS	Native analyte	427.0 > 407.0	0.011				
M2-6:2FTS	IDA	429.0 > 81.0	0.011				
PFHpS	Native analyte	449.0 > 80.0	0.011				
PFHpS_2	Native analyte	449.0 > 99.0	0.011				
PFNA	Native analyte	463.0 > 419.0	0.011				
PFNA_2	Native analyte	463.0 > 169.0	0.011				

13C5 PFNA	IDA	468.0 > 423.0	0.011	[redacted]
PFOS	Native analyte	499.0 > 80.0	0.011	
PFOS_2	Native analyte	499.0 > 99.0	0.011	
9Cl-PF3ONS	Native analyte	531 > 351	0.011	
13C4 PFOS	IDA	503.0 > 80.0	0.011	
PFDA	Native analyte	513.0 > 469.0	0.011	
PFDA_2	Native analyte	513.0 > 169.0	0.011	
13C2 PFDA	IDA	515.0 > 470.0	0.011	
8:2FTS	Native analyte	527.0 > 507.0	0.011	
M2-8:2FTS	IDA	529.0 > 81.0	0.011	
PFNS	Native analyte	549.0 > 80.0	0.011	
PFNS_2	Native analyte	549.0 > 99.0	0.011	
MeFOSAA	Native analyte	570 > 419.0	0.011	
d3-MeFOSAA	IDA	573.0 > 419.0	0.011	
11Cl-PF3OUdS	Native analyte	631 > 451	0.011	
FOSA	Native analyte	498.0 > 78.0	0.011	
13C8 FOSA	IDA	506.0 > 78.0	0.011	
PFUdA	Native analyte	563.0 > 519.0	0.011	
PFUdA_2	Native analyte	563.0 > 169.0	0.011	
13C2 PFUdA	IDA	565.0 > 520.0	0.011	
EtFOSAA	Native analyte	584.0 > 419.0	0.011	
d5-EtFOSAA	IDA	589.0 > 419.0	0.011	
PFDS	Native analyte	599.0 > 80.0	0.011	
PFDS_2	Native analyte	599.0 > 99.0	0.011	
PFDoA	Native analyte	613.0 > 569.0	0.011	
PFDoA_2	Native analyte	613.0 > 169.0	0.011	
13C2 PFDoA	IDA	615.0 > 570.0	0.011	
10:2FTS	Native analyte	627 > 607	0.011	
PFDoS	Native analyte	699 > 80	0.011	
PFDoS_2	Native analyte	699 > 99	0.011	
PFTrDA	Native analyte	663.0 > 619.0	0.011	
PFTrDA_2	Native analyte	663.0 > 169.0	0.011	
PFTeDA	Native analyte	713.0 > 669.0	0.011	
PFTeDA_2	Native analyte	713.0 > 169.0	0.011	
13C2 PFTeDA	IDA	715.0 > 670.0	0.011	
PFHxDA	Native analyte	813 > 769	0.011	
PFHxDA_2	Native analyte	813 > 169	0.011	
13C2 PFHxDA	IDA	815 > 770	0.011	
PFODA	Native analyte	913 > 869	0.011	
PFODA_2	Native analyte	913 > 169	0.011	

Recommended Instrument Operating Conditions				
Retention Times & Quantitation [redacted]				
Native Compounds	**Typical Native RT (minutes)**	**IS analog**	**Typical IDA RT (minutes)**	**Quantitation Method**
PFBA	[redacted]	13C4 PFBA	[redacted]	Isotope Dilution
PFPeA	[redacted]	13C5 PFPeA	[redacted]	Isotope Dilution
PFBS	[redacted]	13C3 PFBS	[redacted]	Isotope Dilution
4:2FTS	[redacted]	M2-4:2FTS	[redacted]	Internal Standard
PFHxA	[redacted]	13C2 PFHxA	[redacted]	Isotope Dilution
PFPeS	[redacted]	13C3 PFBS	[redacted]	Internal Standard
HFPO-DA	[redacted]	13C3 HFPO-DA	[redacted]	Isotope Dilution
PFHpA	[redacted]	13C4 PFHpA	[redacted]	Isotope Dilution
PFHxS	[redacted]	18O2 PFHxS	[redacted]	Isotope Dilution
DONA	[redacted]	13C4 PFOS	[redacted]	Internal Standard
6:2FTS	[redacted]	M2-6:2FTS	[redacted]	Isotope Dilution
PFOA	[redacted]	13C4 PFOA	[redacted]	Isotope Dilution
PFHpS	[redacted]	13C4 PFOS	[redacted]	Internal Standard
PFNA	[redacted]	13C5 PFNA	[redacted]	Isotope Dilution
PFOS	[redacted]	13C4 PFOS	[redacted]	Isotope Dilution
9Cl-PF3ONS	[redacted]	13C4 PFOS	[redacted]	Internal Standard
8:2FTS	[redacted]	M2-8:2FTS	[redacted]	Isotope Dilution
PFDA	[redacted]	13C2 PFDA	[redacted]	Isotope Dilution
PFNS	[redacted]	13C4 PFOS	[redacted]	Internal Standard
MeFOSAA	[redacted]	d3-MeFOSAA	[redacted]	Isotope Dilution
11Cl-PF3OUdS	[redacted]	13C4 PFOS	[redacted]	Internal Standard
EtFOSAA	[redacted]	d5-EtFOSAA	[redacted]	Isotope Dilution
PFDS	[redacted]	13C4 PFOS	[redacted]	Internal Standard
PFUdA	[redacted]	13C2 PFUdA	[redacted]	Isotope Dilution
FOSA	[redacted]	13C8 FOSA	[redacted]	Isotope Dilution
PFDoA	[redacted]	13C2 PFDoA	[redacted]	Isotope Dilution
10:2FTS	[redacted]	M2-8:2FTS	[redacted]	Internal Standard
PFDoS	[redacted]	13C4 PFOS	[redacted]	Internal Standard
PFTrDA	[redacted]	13C2 PFTeDA	[redacted]	Internal Standard
PFTeDA	[redacted]	13C2 PFTeDA	[redacted]	Isotope Dilution
PFHxDA	[redacted]	13C2 PFHxDA	[redacted]	Isotope Dilution
PFODA	[redacted]	13C2 PFHxDA	[redacted]	Internal Standard

Note: clients must be notified when the quantitation of an analyte is performed using an Internal standard. Changes to these IDA/ISTD associations may be necessary when sources of IDAs are updated: this may include additions as new IDAs become available, or subtractions if IDAs are unavailable.

10.4 Instrument Tuning

Instrument tuning is done initially when the method is first developed and thereafter as needed to maintain the sensitivity and selectivity of the method. Tuning is done by infusing each individual compound (native and IDA) into the MS/MS electrospray probe. The responses for the parent and daughter ions for each compound are observed and optimized for sensitivity and resolution. Mass assignments are reviewed and calibrated if necessary. The mass assignments must be within ± 0.5 amu of the values shown in the table above.

10.5 Instrument Calibration

Perform initial calibration with a minimum of five calibration standards before any sample analysis (initial method set-up), whenever a new column is installed, when significant instrument maintenance has been performed, and when the CCV does not meet acceptance criteria. Significant instrument maintenance includes installing a new column, changing the proportioning valve, or changing components of the MS/MS system. A new calibration is not required following minor maintenance.

With the exception of the circumstances delineated in policy CA-Q-P-003, it is not acceptable to remove points from a calibration curve. In any event, at least five points must be included in the calibration curve. Average Response Factor and linear fit calibrations require five points, whereas Quadratic (second order) calibrations require six points. The same injection volume must be used for all injections (standards and extracts).

Calibration is by average response factor, linear fit, or by quadratic fit. Quadratic fit is used for the analyte if the response is non-linear; it's use requires a minimum of 6 calibration standards.

For average response factor (RFa), the relative standard deviation (RSD) for all compounds quantitated by isotope dilution must be < 20% for the curve to be valid.

For average response factor (RFa), the relative standard deviation (RSD) for all compounds quantitated by internal standard (i.e. those compounds that do not have corresponding isotopically labeled analogs) must be < 25% for the curve to be valid.

For linear fit, the intercept of the line must be less than ½ the reporting limit, and the coefficient of determination (r2) must be greater than or equal to 0.990 for the curve to be considered valid (or the correlation coefficient (r) > 0.995).

Evaluation of Calibration Curves

The following requirements must be met for any calibration to be used:

-Response must increase with increasing concentration.

-The absolute value of the intercept of a regression line (linear or non-linear) at zero response must be less than the reporting limit.

-There should be no carryover at or above 1/2 MRL after a high CAL standard.

-The low cal. point must recover to within 50-150%, and all others must recover to within 70-130%.

If these criteria are not met, instrument conditions and standards will be checked, and the ICAL successfully repeated before continuing.

Weighting of Calibration Points

In linear and quadratic calibration fits, the points at the lower end of the calibration curve have less absolute variance than points at the high concentration end of the curve. This can cause severe errors in quantitation at the low end of the calibration. Because accuracy at the low end of the curve is very important for this analysis, it is preferable to increase the weighting of the lower concentration points. 1/concentration or 1/x weighting is encouraged. Visual inspection of the line fitted to the data is important in selecting the best fit.

10.6 Initial Calibration

Prepare the working calibration standards using the recommended formulations given in Appendix B ensuring the lowest calibration standard for each analyte is equal to or below the established RL. Unless otherwise specified on a project basis, use calibration levels 1 to 6 to establish the calibration curve for each analyte.

Prime the instrument by analyzing a minimum of 4 “primer” solutions consisting of 80/20 methanol/water. In general, an HPLC contains components made from PTFE, which enable the pumps to work with many types of organic solvents. Despite efforts to remove as much PTFE as possible, certain components cannot be replaced and contribute PFAS. The longer the system remains idle, the more PFAS that is yielded. Therefore these primers serve to reduce and stabilize the amount of PFAS that are contributed. Immediately following the primers is a Blank, the ICAL sequence (run in ascending order of Level 1 to Level 6), the ICB, the ICV and the first analytical window of extracts (up to 10 field samples). The data is acquired using Sciex’s Analyst 1.6.

The Chrom Review data system generates calibration data by generating relative response factors (RRFs) based on the response of the target analyte and its corresponding Isotope Dilution Analyte (or Internal Standard) as well as their injection concentrations to ultimately generate Mean Response Factors. All analytes calibrated using IDA must have RSD values < 20%, all analytes calibrated using ISTD must have RSD values < 25%. The IDA compounds are also calibrated using an external RF model using response and concentration. The IDA RSD must be < 50%. Alternatively, a linear regression curve of concentration vs. peak area for each analyte relative to their corresponding IDA/ISTD and their concentrations calculates the correlation coefficient with 1/concentration weighting. The calibration must have a correlation coefficient (r) $\geq$ 0.995 ($r^2 \geq 0.990$). If criteria are not met, correct the problem and repeat calibration. Further analysis may not proceed without valid calibration.

10.7 Initial Calibration Blank (ICB)

Immediately following the ICAL, a calibration blank is analyzed that consists of an injection of [redacted] fortified with IDA solution at 50 ng/mL

The result for the calibration blank must be less than the reporting limit.

If the ICB is greater than the reporting limit then the source of contamination must be identified and any necessary cleaning completed, and then the instrument should be recalibrated.

10.8 Second Source Calibration Verification (ICV)

Following the ICAL and the ICB, an ICV standard obtained from a different source or vendor than the ICAL standards is analyzed. This ICV standard is a mid-range standard.

The recovery for the ICV must meet the appropriate following criteria:

The native analyte must be within or equal to 70-130% for all native analytes quantitated by isotope dilution.

The native analyte must be within or equal to 70-130% for all native analytes quantitated by internal standard (i.e. those compounds that do not have corresponding isotopically labeled analogs).

The IDA recovery must be within or equal to 50-150%.

See Table 3 for corrective actions in the event that the ICV does not meet the criteria above.

10.9 Continuing Calibration Verification (CCV)

Analyze a CCV at the beginning of a run, the end of a run, and after every 10 samples to determine if the calibration is still valid. The exception is after an acceptable curve and ICV are run 10 samples can be analyzed before a CCV is required. The CCVs are usually at the mid-level range of the curve and should vary throughout the run. The curve and ICV do not need to be run every day. To start an analytical run a CCV can be analyzed and if it meets acceptance criteria a run can be started. In addition, the low standard in the curve must be analyzed and must be within ± 50% of the expected value.

The recovery for the CCV standards must be equal to or within 70-130% (50-150% for low level standards) for all natives quantitated by isotope dilution and for all natives quantitated by internal standard. The recovery for the IDA must be within or equal to 70-130% of the true value.

If this is not achieved, the instrument has drifted outside the calibration limits. If the CCV fails again following minor maintenance, the instrument must be recalibrated.

10.10 Isotope Dilution Analytes (IDA)

The IDA solution is added to each field and QC sample at the time of extraction, as described in Section 10.1. As described in Section 7, this solution consists of isotopically labeled analogs of the analytes of interest.

IDA recoveries are flagged if they are outside of the acceptance limits. Quantitation by isotope dilution generally precludes any adverse effect on data quality due to IDA recoveries being outside of the acceptance limits as long as the signal-to-noise ratio is greater than 10:1.

> Evaluate data quality for usability, flag and submit a non-conformance memo for any analytes outside of the recovery criteria, and report if data is deemed not adversely effected.
>
> Re-extraction of samples should be performed if the signal-to-noise for any IDA is less than 10:1 or if the IDA recoveries fall below 10%.
>
> Re-extraction may be necessary under other circumstances when data quality has been determined to be adversely affected.

10.11 Troubleshooting:

Check the following items in case of calibration failures:

Evaluate the failure to determine whether it affects all of the compounds in the ICAL equally. If one ICAL point appears low or high, reprep the curve and rerun, as the error was most likely prep-based. If only a subset of the analytes are affected, check the integration and chromatography to see if there are anomalies; if justifiable, correct the integration so it is consistent with the other ICAL levels.

If there are no peaks for all compounds or no peaks after a specific retention time, ensure that the HPLC pump is pumping properly; it may have shut down due to overpressure or has a leak. If the

pump has shut down, confirm it is primed and replace the in-line filter. If the pressure climbs above expected levels, changing the guard column and even analytical column may be necessary. It's best to chase high pressure sources from the pump forward (ie the post-pump in-line filter, isolator column, post-autosampler in-line filter, guard column, analytical column and MSMS inlet. If the pump is still pumping, check the system pressure. If it is lower than expected, check for leaks. Start with all connections, then move on to pump seals, especially if there are wide variations in pressure when pumping the same solvents at the same flow rates. If the pump is still pumping and the pressure is normal, check to make sure the MSMS is still functioning properly. Most issues with the MSMS system will be noted by the instrument software.

If there are peaks for all analytes, evaluate the peak shapes by comparing them to the ICAL chromatography. If the peaks have changed (shorter and wider), a new guard column may improve peak shape and bring the system back into compliance. If a new column is necessary, a new ICAL will be needed.

Preventive and routine maintenance is described in the table below

HPLC/MS/MS Preventative Maintenance
As Needed: Change pump seals. Change in-line filters in autosampler (HPLC). Check/replace in-line frit if excessive pressure or poor performance. Replace column if no change following in-line frit change. Replace fused silica tube in ESI interface. Clean lenses. Clean skimmer. Ballast rough pump 30 minutes.
Daily (When in use) Check solvent reservoirs for sufficient level of solvent. Verify that pump is primed, operating pulse free. Check needle wash reservoir for sufficient solvent. Verify capillary heater temperature functioning. Verify vaporizer heater temperature. Verify rough pump oil levels. Verify turbo-pump functioning. Verify nitrogen pressure for auxiliary and sheath gasses. Verify that multiplier is functioning.

10.12 Sample Analysis

Place the field and QC samples in a sequence that begins with the calibration standards followed by the analysis of QC samples, field samples and continuing calibration verification standards (CCVs).

An example analytical sequence that includes initial calibration (ICAL) is provided below.

Injection Number	Lab Description
1	Primer 1
2	Primer 2
3	Primer 3

Injection Number	Lab Description
4	Primer 4
5	Blank
6	Calibration Level 1
7	Calibration Level 2
8	Calibration Level 3
9	Calibration Level 4 (ICIS)
10	Calibration Level 5
11	Calibration Level 6
12	ICB
13	ICV
14	T-PFOA
15	MB
16	LCS
17-26	(up to) 10 Field samples
27	CCV L4
28-37	(up to) 10 Field samples
38	MS
39	MSD
40	CCV L5
41	MB
42	LCS
43-52	(up to) 10 Field samples
53	CCV L4
54-63	(up to) 10 Field samples
65	MS
66	MSD
67	CCV L5

An example analytical sequence without ICAL:

Injection Number	Lab Description
1	Primer 1
2	Primer 2
3	Primer 3
4	Primer 4
5	CCB
6	CCVL (LOQV)
7	CCVIS (L4)
8	MB
9	LCS
10-19	(up to) 10 Field samples
20	CCV L5
21-30	(up to) 10 Field samples
31	MS
32	MSD
33	CCV L4
34	MB
35	LCS

36-45	(up to) 10 Field samples
46	CCV L5
47-56	(up to) 10 Field samples
57	MS
58	MSD
59	CCV L4

Enter the sample ID's into the data acquisition program in the order the samples were placed in the autosampler and initiate the analytical sequence.

11.0 Corrective Action

When an out-of-control situation occurs that is not delineated in this corrective action table or the corrective actions listed do not adequately address the circumstances, a Corrective Action Report (CAR) (NCM), etc., must be developed (see SOP BR-QA-016) and the analyst must use his/her best analytical judgment and available resources to determine the corrective action to be taken. The out-of-control situation may be caused by more than one variable. The analyst should seek the assistance of his/her immediate supervisor, QA manager or other experienced staff if they are uncertain of the cause of the out-of-control situation. The analysis must not be resumed until the source of the problem and an in-control status is re-established. All samples associated with the out-of-control situation must be reanalyzed after in-control status has been re-established or if authorization is received from the supervisor or QA Manager for release with data qualification.

12.0 Calculations / Data Reduction

12.1 Qualitative Identification

The data processing system identifies the target analytes by comparing the retention time of the peaks to the retention times of the initial calibration standards. The retention times of PFAS with labeled standards must be the same as that of the labeled IDA's to within 0.05 min. For PFAS with no labeled standards, the RT must be within ± 0.3 minutes of the CCVIS standards. *Note: The IS RT and native RT may be offset by 0.02 to 0.04 minutes.*

12.2 Quantitative Identification

The ICAL established in Section 10.10 is used to calculate concentrations for the extracts. The data processing system determines on-column concentration. Final results are calculated by the laboratory's LIMS information system (TALS).

Dilute and reanalyze samples whose results exceed the calibration range. The diluted analysis should result in a determination within the upper half of the calibration curve.

Check the results of samples analyzed immediately after high concentration samples (those with results above calibration range) for signs of carry-over. Reanalyze all samples suspected of carry -over.

12.3 Calculations

See Appendix C.

12.4 Data Review

Refer to laboratory SOP BR-QA-019 for additional instruction on the requirements for data review. The following sections summarize the general procedure as described in the data review SOP.

12.5 Primary Review

Review the chromatography and quantitation in the data processing system to confirm quantitative and qualitative identification of each target analyte. Perform and document manual integrations only if needed per the instructions in corporate policy CA-Q-S-002, Acceptable Manual Integration Practices.

Upload the data files to TALS and process the batch. Enter job information into the batch editor and add the standards and reagent additions to the worksheet, if necessary. Review the results against acceptance criteria. If acceptance criteria are not met, perform corrective action or make arrangements for corrective action with another analyst.

Set results to primary, secondary, acceptable or rejected. Set results to be reported to a status of primary and secondary. Set results that meet criteria but will not be reported to acceptable. Set results that do not meet criteria to rejected, to prevent inadvertent reporting of data.

Verify that all appropriate QC were performed and acceptable. If insufficient volume is received (MS, MSD, FRB, etc…) document in an NCM. Record all instances where acceptance criteria are not met in a nonconformance memo (NCM).

Verify that all project requirements or program specific requirements were followed. If not, immediately notify the project manager to determine an appropriate course of action. Record decisions made in the data review checklist.

Set the batch to 1st level review. Complete the data review checklist and make arrangements for secondary review by a peer analyst.

12.6 Secondary Data Review (Performed by Peer Analyst)

Record review using the data review checklist.

Verify that all project requirements or program specific requirements were followed. If not, consult with the primary analyst to determine cause. Any decisions made should be recorded on the data review checklist and retained as part of the analytical record.

Review the TALS batch editor to verify ancillary information for the work performed is filled in.

Verify that that the procedures in this SOP were followed. If discrepancy between the SOP and the analytical record is found, consult with the primary analyst to determine the source of the discrepancy. Resolve the discrepancy and verify any modifications to the SOP are properly

documented and were approved by laboratory management. Record all SOP deviations in an NCM.

Spot-check ~15% of samples in the batch to verify quantitative and qualitative identification.

If manual integrations were performed:

- Review each manual integration to verify that the integration is consistent and compliant with the requirements specified in SOP CA-Q-S-002.

- Check to ensure an appropriate technical reason code is provided for each manual integration. Acceptable technical reason codes are provided in SOP CA-Q-S-002.

- If an error is suspected, the reviewer must consult with the analyst that performed the integration to determine if a correction is necessary. Input from the Technical Manager (TM), Department Manager (DM), or QA Manager (QAM) may be sought as necessary. **The reviewer may not reintegrate except in those circumstances approved by laboratory management**, such as when the analyst that performed the integration is on vacation. If re-integration is performed by the reviewer, the reviewer is now considered the "primary analyst" and the re-integration is subject to the same review and documentation requirements as the original integration.

Verify acceptance criteria were met. If not, verify that corrective actions were performed and the nonconformance was documented with an NCM. Review the NCM to verify the form is filled out and the requisite information has been included in the internal comments tab. If corrective action was not performed and the failure not documented, consult with the primary analyst to determine cause. Consult with the primary analyst and department management to determine what actions should be taken, then follow-through with the decision made.

Run the QC checker and fix any problems found. Run and review the deliverable for gross error such as missing data. Fix any problems found.

When review is complete set the method chain to lab complete. Complete the data review checklist and forward associated paperwork to report/project management.

12.7 Data Reporting & Record Retention

The specifications for data reporting are set by the project manager and are performed by TALS using the formatter selected by the PM. The type of deliverable is also set by the PM based on various deliverable options in the TALS system. The formatters and deliverables are programmed into TALS by corporate IT staff and cannot be modified locally.

The following sections describe the default reporting scheme set for this method in TALS:

Data is retained, managed and archived as specified in laboratory SOP BR-QA-014 Laboratory Records.

13.0 Method Performance

13.1 Method Detection Limit Study (MDL)

The method detection limit (MDL) is the lowest concentration that can be detected for a given analytical method and sample matrix with 99% confidence that the analyte is present. MDLs reflect a calculated (statistical) value determined under ideal laboratory conditions in a clean matrix, and may not be achievable in all environmental matrices. An initial method detection limit study is performed in accordance with SOP BR-QA-005. The laboratory maintains MDL studies for analyses performed; these are verified at least annually unless method or program requirements require a greater frequency.

13.2 Demonstration of Capabilities

All personnel are required to perform an initial demonstration of proficiency (IDOC) on the instrument they will be using for analysis prior to testing samples. On-going proficiency must be demonstrated annually. IDOCs and on-going proficiency demonstrations are conducted as follows.

13.2.1 Four aliquots of the QC check sample are analyzed using the same procedures used to analyze samples, including sample preparation. The concentration of the QC check sample may be equivalent to a mid- level calibration.

13.2.2 Calculate the average recovery and standard deviation of the recovery for each analyte of interest.

13.2.3 If any analyte does not meet the acceptance criteria, the test must be repeated. Only those analytes that did not meet criteria in the first test need to be evaluated. TNI 2016 requires consecutive passing results. Repeated failure for any analyte indicates the need for the laboratory to evaluate the analytical procedure and take corrective action.

13.2.4 Until the IDOC is approved by the QA Manager (or designee); the trainer and trainee must be identified in the batch record.

13.3 Training Requirements

The Group Leader is responsible for ensuring that this procedure is performed by an associate who has been properly trained in its use and has the required experience. A new analyst must be working under documented supervision prior to approval of the IDOC. Documentation that a new analyst is performing under supervision must be entered into the batch record (View Batch Information) until that analyst's IDOC has been approved by the QA Manager (or designee). See requirements for demonstration of analyst proficiency in SOP BR-QA-011.

14.0 Pollution Control

Employees must abide by the policies and procedures in the NDSC Eurofins TestAmerica Laboratories Environmental Health and Safety Manual (CW-E-M-001), Radiation Safety Manual and this document. This procedure may involve hazardous material, operations and equipment. This SOP does not purport to address all of the safety problems associated with its use. It is the responsibility of the user of the method to follow appropriate safety, waste disposal and health practices under the assumption that all samples and reagents are potentially hazardous. Safety glasses, gloves, lab coats and closed-toe, nonabsorbent shoes are a minimum.

15.0 Waste Management

Waste management practices are conducted consistent with all applicable rules and regulations. Excess reagents, samples and method process wastes are disposed of in an accepted manner. Waste description rules and land disposal restrictions are followed. Waste disposal procedures are incorporated by reference to BR-EH-001. The following waste streams are produced when this method is carried out.

- Vials containing sample extracts: Satellite Container: 30 gallon poly barrel located under GC-Semi prep hood.
- Solvent Waste: Satellite Container: 5 gallon poly carboy located under LCMSMS.

16.0 References / Cross References

- Cheryl Moody, Wai Chi Kwan, Johnathan W. Martin, Derek C. G. Muir, Scott A. Mabury, "Determination of Perfluorinated Surfactants in Surface Water Samples by Two Independent Analytical Techniques: Liquid Chromatography/Tandem Mass Spectrometry and 19FNMR," Analytical Chemistry 2001, 73, 2200-2206.
- John Giesy et al., "Accumulation of Perfluorooctane Sulfonate in Marine Mammals", Environmental Science & Technology, 2001 Vol. 35, No. 8, pages 1593-1598.
- U.S. EPA, "Residue Chemistry Test Guidelines, OPPTS 860.1340, Residue Analytical Method", EPA 712-C-95-174, August 1995.
- STL Denver White Paper DEN-W-LC-002, "Method Validation Study for Analysis of Ammonium Perfluorooctanoate in Soil Matrices by High Performance Liquid Chromatography/Mass Spectrometry (HPLC/MS/MS)", Mark Dymerski, September 5, 2003.
- STL Denver White Paper DEN-W-LC-003, "Addendum A to Method Validation Study for Analysis of Ammonium Perfluorooctanoate in Soil Matrices by High Performance Liquid Chromatography/Mass Spectrometry (HPLC/MS/MS)", Mark Dymerski, August 6, 2003.
- STL Denver White Paper DEN-W-LC-004, "Method Validation Study for Analysis of Perfluorooctanoic Acid in Waters by High Performance Liquid Chromatography/Tandem Mass Spectrometry (HPLC/MS/MS)", Mark Dymerski, January 26, 2005.
- Waters application note; "Acquity UPLC System for Quantifying Trace Levels of Perfluorinated Compounds with an Acquity PFC Analysis Kit", Peter J. Lee, Evan T. Bernier, Gordon T. Fujimoto, Jeremy Shia, Michael S. Young, and Alice J. Di Gloia, Waters Corporation, Milford, MA. USA.
- Method ISO 25101, "Water quality – Determination of perfluorooctanesulfonate (PFOS) and perfluorooctanoate (PFOA) – Method for unfiltered samples using solid phase extraction and liquid chromatography/mass spectrometry", First Edition, 2009-03-01, International Organization for Standardization, Technical Committee ISO/TC 147, Water Quality, Subcommittee SC 2, Physical, chemical and biochemical methods.
- US EPA, "Method 537 - Determination of Selected Perfluorinated alkyl acids in Drinking Water by Solid Phase Extraction and Liquid Chromatography/Tandem Mass Spectrometery (LC/MS/MS)", Version 1.1, September 2009, J.A. Shoemaker, P.E. Grimmett, B.K. Boutin, EPA Document #: EPA/600/R-08/092.
- Laboratory SOP BR-QA-005 *Procedures for the Determination of Limits of Detection (LOD), Limits of Quantitation (LOQ) and Reporting Limits (RL).*
- Laboratory SOP BR-QA-011 *Employee Training*
- Laboratory SOP BR-EH-001 *Hazardous Waste*
- Laboratory SOP BR-QA-014 *Laboratory Records*

- Laboratory SOP BR-QA-006 *Procedures & Documentation Requirements for Manual Integration*
- Laboratory Quality Assurance Manual (QAM)
- Corporate TestAmerica SOP CA-Q-S-002 *Manual Integrations*.

17.0 Method Modifications

Modification Number	Method Reference	Modification & Technical Justification
1	Section 7.2	Method 25101 specifies that the values reported for PFOA and PFOS shall be the linear isomer only. In keeping with the dictates of USEPA 537 and other US conventions, the laboratory reports both the branched (when present) and linear isomers as a single value for these compounds.
2	Section 10.1	A different SPE cartridge, Waters OASIS WAX, is used for the extraction process. As a result, solvents and elution procedures are different.
3	Section 10.1	The samples are fortified with a greater number of labeled analytes (most analytes have labeled versions) prior to extraction.
4	Section 10.5	The HPLC Column, Eluents and gradient conditions have changed.
5	Section 10.5	For non-drinking water matrices, the analyte list has expanded. The number of labeled analytes has also expanded to improve quantitation.
6	Table 1	The reporting limits have changed to a consistent value.
7	Appendix B	Calibration levels have been changed so all levels have the same analyte concentration.

18.0 Attachments

- Table 1: Routine Compound List and LOQ
- Table 2: Primary Materials Used
- Table 3: QC Summary & Recommended Corrective Action
- Table 4: Control Limits
- Appendix A: Terms and Definitions
- Appendix B: Standard Preparation Tables
- Appendix C: Equations

19.0 Revision History (all revision history must be retained in this SOP)

Revision 6.1: Date effective 09/28/2020

- Updated cover page dates and signatories
- Section 1.1: Updated reporting limit ranges to reflect current practice. Added clarification for non-potable samples are only analyzed in NJ.

- Section 7.3: Updated standard preparation solutions for IDA solution from 1000 ng/mL to 500 ng/mL and Internal standard solution from 2500 ng/mL to 1250 ng/mL to reflect current practice.
- Section 8.0: Added 28 day holding time specific to samples collected in NJ.
- Section 10.1: Changed IDA solution to have a fixed concentration of 1.25 ng/mL
- Sections 10.1.5 and 10.2.5.: Updated Internal standard used from 2500 ng/mL to 1250 ng/mL to reflect current practice.
- Sections 5.0 and 11.0: Update to standard language as required by corporate NDSC.
- Section 19.0: Added effective dates.
- Table 1: Updated reporting limits to reflect current practice.
- Table 3: Added NJ specific requirement.
- Appendix B: Updated information to for IDA and Internal Standard formulations to reflect current practice.

Revision 6.0: Date effective 04/24/2020

- Updated cover page dates, copyright information, and signatories
- Throughout: Added support for soil, sediment and tissue matrices.
- Throughout: Removed reference to analysis using Waters instrumentation.
- Throughout: Removed reference to final extract concentration for aqueous samples.
- Section 1.1: Update Fluorotelomer sulfonates (FTS) to report acid forms
- Section 11.0: Added corrective action requirement as it is a corporate requirement to include.

Revision 5.0: Date effective 10/11/2019

- Updated cover page dates, copyright information, and signatories
- Throughout: removed references to drinking water. Will add back if adopted.
- Throughout: removed solid extraction/analysis verbiage missed in previous revision.
- Throughout: revised formatting to be consistent
- Throughout: added PFHxDA, PFODA, PFDoS, 10:2FTS, HFPO_DA, DONA, F53BMajor, and F53B Minor as additional analytes and IDAs
- Section 4.0: added interference information about $^{13}C_2$-PFHxDA
- Section 6.1: updated to include additional laboratory apparatus information
- Section 6.2: updated to include additional instrument and more detail for existing instrument
- Section 7.1: added more detail to reagent information and the addition of Ammonium acetate and Ammonium hydroxide
- Section 7.2: added PFHpS and PFDS as other PFAS not available in the acid form. Added the IDA and ISTD are added at a fixed concentration and removed the low level reference
- Section 9.1 added a NCM must be added for MS/MSD
- Section 10.1: removed the low level spike reference and added the PFAS-IDA solution is added to each sample and QC sample in concentrated extract and non-concentrated extracts
- Section 10.2: In the previous version of this SOP, the “Note” was removed and replaced with “Warning: The use of a vacuum system creates the risk of glassware implosion. Inspect All glassware prior to use. Glassware with chips, scratches, rub marks or cracks must not be used.”
- Section 10.2: changed wording to clarify addition of poly siphon line into the SPE cartridge

- Section 10.3: removed to keep test tube as keep and added “Note: If the extracts will note be concentrated, [redacted] for the second bottle rinse so the final volume is approximately 8mL.”
- Section 10.5: added sample cleanup with graphitized carbon section
- Section 10.6: added wording to have [redacted] of reagent water to the 10mL extract at this time
- Section 10.7: updated wording
- Section 10.8: added operating system for new instrument and added more detail for existing instrument
- Section 10.17: updated sample analysis to include calibration currently in use
- Table 1 and Table 4: updated to include additional analytes and IDAs
- Appendix A: updated terms and definitions from body of SOP
- Appendix B: updated to include additional analytes and IDAs

Revision 4.0: Date effective 04/12/2019

- Updated cover page dates, copyright information, and signatories
- Headers: removed TestAmerica logo and added Eurofins logo
- Throughout: removed references to drinking water. Will add back if adopted.
- Throughout: revised formatting to be consistent
- Section 1.1: added note about addition of Appendix D, removed NJDEP as PAB
- Section 10.1.3: added note about the use of glass pipettes
- Section 10.3: In a previous version of this SOP, Table “Recommended Instrument Operating Conditions” incorrectly referenced PFTrDA as Isotope Dilution, so this was corrected to Internal Standard and added note to contact clients for ISTD quantitation.
- Removed verbiage regarding soil LOQ from Note on Table 1.
- Added Appendix D: NJDEP secondary certified analytes list

Revision 3.0: Date effect 12/12/2018

- Updated cover page dates and signatories
- Section 10.1: added note for handling incomplete volume extraction process
- Section 18: added previous revision history back into SOP
- Throughout: updated QC criteria from EPA 537 r1.1 that was missed in previous revision
- Throughout: removed solid extraction/analysis verbiage missed in previous revision.
- Throughout: updated calibration to include criteria from EPA 537 r1.1 and to include the 9 calibration points currently in use.
- Throughout: minor formatting updates

Rev 2.1: Date effective 10/11/2018

- Updated cover page dates and signatories
- Section 8: added preservation requirements for DW samples.
- Throughout: updated QC criteria to match EPA537 rev1.1
- Throughout: removed references to solid and tissue extraction/analysis.

Rev 2.0: Date effective 07/31/2018

- Updated cover page and signatories
- Section 8: added preservation requirements for DW samples.
- Throughout: included verbiage that Non-drinking water matrices are not certified under PAB.
- Throughout: separated DW and non-DW limits and QC requirements.

- Throughout: minor formatting and typographical corrections.
- Tables 3 & 4: updated limit to meet EPA 537 criteria.
- Appendix A: updated terms and definitions from body of SOP

Rev 1.0: Date effective 01/19/2018

- Extended analyte list to 21 native compounds and 18 IDAs.
- Altered concentration step in extract preparation by employing a reagent water keeper instead of concentrating to dryness.
- Incorporated use of internal standard for IDA recovery calculation.

Revision 0.0: Date effective 05/19/2017

- New SOP based on USEPA method 537

Previous revisions are retained by the QA department.

Table 1: Routine Compound List & Limit of Quantitation (LOQ)

Compound Name	Abbreviation	CAS #	Water (ng/L)	Soil/ Sediment (ug/Kg)	Tissue (ug/Kg)
Perfluoroalkylcarboxylic acids (PFCAs)					
Perfluoro-n-butanoic acid	PFBA	375-22-4	5.0	0.50	1.0
Perfluoro-n-pentanoic acid	PFPeA	2706-90-3	2.0	0.20	1.0
Perfluoro-n-hexanoic acid	PFHxA	307-24-4	2.0	0.20	1.0
Perfluoro-n-heptanoic acid	PFHpA	375-85-9	2.0	0.20	1.0
Perfluoro-n-octanoic acid	PFOA	335-67-1	2.0	0.20	1.0
Perfluoro-n-nonanoic acid	PFNA	375-95-1	2.0	0.20	1.0
Perfluoro-n-decanoic acid	PFDA	335-76-2	2.0	0.20	1.0
Perfluoro-n-undecanoic acid	PFUdA	2058-94-8	2.0	0.20	1.0
Perfluoro-n-dodecanoic acid	PFDoA	307-55-1	2.0	0.20	1.0
Perfluoro-n-tridecanoic acid	PFTrDA	72629-94-8	2.0	0.20	1.0
Perfluoro-n-tetradecanoic acid	PFTeDA	376-06-7	2.0	0.20	1.0
Perfluoro-n-hexadecanoic acid	PFHxDA	67905-19-5	2.0	0.20	1.0
Perfluoro-n-octadecanoic acid	PFODA	16517-11-6	2.0	0.20	1.0
Perfluorinated sulfonic acids (PFSAs)					
Perfluoro-1-butanesulfonic acid	PFBS	375-73-5	2.0	0.20	1.0
Perfluoro-1-pentanesulfonic acid	PFPeS	2706-91-4	2.0	0.20	1.0
Perfluoro-1-hexanesulfonic acid	PFHxS	355-46-4	2.0	0.20	1.0
Perfluoro-1-heptanesulfonic acid	PFHpS	375-92-8	2.0	0.20	1.0
Perfluoro-1-octanesulfonic acid	PFOS	1763-23-1	2.0	0.20	1.0
Perfluoro-1-nonanesulfonic acid	PFNS	68259-12-1	2.0	0.20	1.0
Perfluoro-1-decanesulfonic acid	PFDS	335-77-3	2.0	0.20	1.0
Perfluoro-1-dodecanesulfonic acid	PFDoS	79780-39-5	2.0	0.20	1.0
Perfluorinated sulfonamides (FOSA)					
Perfluoro-1-octanesulfonamide	FOSA	754-91-6	2.0	0.20	1.0
Perfluorinated sulfonamidoacetic acids (FOSAA)					
N-ethylperfluoro-1-octanesulfonamidoacetic acid	EtFOSAA	2991-50-6	5.0	2.0	10.0
N-methylperfluoro-1-octanesulfonamidoacetic acid	MeFOSAA	2355-31-9	5.0	2.0	10.0
Fluorotelomer sulfonates (FTS)					
1H,1H,2H,2H-perfluorohexane sulfonate *(4:2)*	4:2 FTS	757124-72-4	2.0	2.0	10.0
1H,1H,2H,2H-perfluorooctane sulfonate *(6:2)*	6:2 FTS	27619-97-2	5.0	2.0	10.0
1H,1H,2H,2H-perfluorodecane sulfonate *(8:2)*	8:2 FTS	39108-34-4	2.0	2.0	10.0
1H,1H,2H,2H-perfluorododecane sulfonate*(10:2)*	10:2 FTS	120226-60-0	2.0	2.0	10.0
Fluorinated Replacement Chemicals					
Hexafluoropropylene oxide dimer acid	HFPO-DA	13252-13-6	4.0	0.40	2.0
4,8-dioxa-3H-perfluorononanoic acid	DONA	919005-14-4	2.0	0.20	1.0
9-chlorohexadecafluoro-3-oxanonane-1-sulfonic acid	F53B Major (9Cl-PF3ONS)	756426-58-1	2.0	0.20	1.0
11-chloroeicosafluoro-3-oxaundecane-1-sulfonic acid	F53B Minor (11Cl-PF3OUdS)	763051-58-1	2.0	0.20	1.0

NOTE: The LOQ values may vary. The Water LOQ is based on a 250mL nominal sample volume.

Table 2: Primary Materials Used

Material[1]	Hazards	Exposure Limit[2]	Signs and Symptoms of Exposure
Acetic Acid (3-2-1)	Corrosive Poison Flammable	10 ppm-TWA 15 ppm-STEL	Contact with concentrated solution may cause serious damage to the skin and eyes. Inhalation of concentrated vapors may cause serious damage to the lining of the nose, throat, and lungs. Breathing difficulties may occur.
Ammonium Hydroxide (3-0-0)	Corrosive Poison	50 ppm-TWA	Severe irritant. Effects from inhalation of dust or mist vary from mild irritation to serious damage to the upper respiratory tract. Symptoms may include sneezing, sore throat or runny nose. Contact with skin can cause irritation or severe burns and scarring with greater exposures. Causes irritation of eyes, and with greater exposures it can cause burns that may result in permanent damage, including blindness. Brief exposure to 5000 PPM can be fatal.
Hexane (2-3-0)	Flammable Irritant	500 ppm-TWA	Inhalation of vapors irritates the respiratory tract. Overexposure may cause lightheadedness, nausea, headache, and blurred vision. Vapors may cause irritation to the skin and eyes.
Hydrochloric Acid (3-0-1)	Corrosive Poison	5 ppm (Ceiling)	Can cause pain and severe burns upon inhalation, ingestion, eye or skin contact. Exposure to concentrated solutions may cause deep ulcerations to skin, permanent eye damage, circulatory failure and swallowing may be fatal.
Methanol (2-3-0)	Flammable Poison Irritant	200 ppm (TWA)	A slight irritant to the mucous membranes. Toxic effects exerted upon nervous system, particularly the optic nerve. Symptoms of overexposure may include headache, drowsiness and dizziness. Methyl alcohol is a defatting agent and may cause skin to become dry and cracked. Skin absorption can occur; symptoms may parallel inhalation exposure. Irritant to the eyes.
Potassium Hydroxide (3-0-1)	Corrosive Poison		Severe irritant. Can cause severe burns upon inhalation, ingestion, eye or skin contact. Exposure to concentrated solutions may cause severe scarring of tissue, blindness, and may be fatal if swallowed.
Potassium Persulfate (2-0-1-OX)	Oxidizer	None	Causes irritation to the respiratory tract. Symptoms may include coughing, shortness of breath. Causes irritation to skin and eyes. Symptoms include redness, itching, and pain. May cause dermatitis, burns, and moderate skin necrosis.

[1] Always add acid to water to prevent violent reactions.
[2] Exposure limit refers to the OSHA regulatory exposure limit.

Table 3: QC Summary, Acceptance Criteria and Recommended Corrective Action (EPA537)

QC Check	Minimum Frequency	Acceptance Criteria	Corrective Action
6-Point Calibration (5 point minimum for CF and Linear Regression) (ICAL)	Before sample analysis, when CCVs indicate calibration is no longer valid; after major instrument maintenance	CF = RSD $\leq$ 20% (compounds calibrated via IDA) CF = RSD $\leq$ 25% (compounds calibrated using "near-IDA" compounds) CF = RSD $\leq$ 50% (IDA standards using ISTD) Each cal pt. = +/-30%Rec. (+/-50%Rec for cal low pt.) Linear Regression: $r^2 \geq 0.990$	Correct problem and repeat initial calibration.
IDA Response	Every injection contains the IDA analytes	Non-DW matrices (for samples collected in NJ – see below): Standards: 50-150% recovery Field samples: 50-150% recovery (poor responding IDAs: 25-150%) (reportable if >10x S/N ratio and >10% ICAL RF)	Standard failures must be investigated to determine the cause of the failure. Recalibration may be required. Samples with recoveries outside acceptance limits must be evaluated for data usability. Re-extraction may be necessary if data quality has been adversely affected.
IDA Response	Every injection contains the IDA analytes	Non-Potable samples collected in NJ: Standards: 50-150% recovery Field samples: 50-150% recovery (reportable if >10x S/N ratio and >10% ICAL RF)	Standard failures must be investigated to determine the cause of the failure. Recalibration may be required. Samples with recoveries outside acceptance limits must be evaluated for data usability. Re-extraction may be necessary if data quality has been adversely affected.
IS Response	Every injection contains the IS analyte	ICAL Standards: Area of individual points must not deviate by more than 50% of ICAL mean area response Samples following ICAL: 50-150% of ICAL mean response Ongoing CCV: 50-150% of ICAL mean response Post-CCV Samples: Area must be within 50-150% of most recent CCVIS (daily opening CCV)	Standard failures must be investigated to determine the cause of the failure. Recalibration may be required. Sample failures may be matrix related and should be evaluated to determine if the data quality has been adversely affected.
Initial Calibration Blank (ICB)	Immediately following the ICAL	Non-DW: < RL for all target analytes	Determine source of interference/contamination, eliminate it and recalibrate.
Second Source Standard Verification (ICV)	Prior to the analysis of samples. Generally immediately after the ICB.	+/-30 for analytes, IS, and SUR.	Correct problem and verify second source standard. If that fails, repeat calibration.
Continuing Calibration Verification (CCV)	Beginning of each analytical sequence, every ten field samples and at the end of each analytical sequence. Alternate between levels 3, 4 and 5.	+/-30%	Rerun any samples analyzed before and after the failing CCV. Take corrective action; if subsequent CCV analyses fail, recalibrate instrument.
Continuing Calibration Verification-Low (CCVL)	Beginning of each analytical sequence that is not preceded by an ICAL to show LOQ is still valid.	CF = 50-150% (ISTD targets) IDA 50-150%	Stop sample acquisition. Take corrective action; if subsequent CCV analyses fail, recalibrate instrument.

QC Check	Minimum Frequency	Acceptance Criteria	Corrective Action
Method Blank	One per extraction batch of 20 or fewer samples	Non-DW: < RL for all target analytes	Reprocess MB and associated samples if any target analyte in the MB is at or above the RL, greater than 1/10 the amount detected in any sample or 1/10 the regulatory limit, whichever is greater. If the target is not greater than the RL in the samples associated with an unacceptable method blank, the data may be reported with appropriate qualifiers. If insufficient sample is available to reprocess, report data with appropriate qualifiers.
Laboratory Control Sample	One per extraction batch of 20 or fewer samples (rotate between Low, Med, High)	%R within control limits. See Table 4	Reprep and reanalyze samples for failed analytes. If reanalysis is not possible due to insufficient sample volume, report data with appropriate data qualifiers.
Matrix Spike / Matrix Spike Duplicate	One set per extraction batch when sufficient sample volume is provided	%R within control limits. See Table 4	Evaluate to determine if there is a matrix effect or analytical error. If analytical error, reanalyze or reprocess as appropriate.
Sample Duplicate	One per extraction batch of 20 or fewer samples	RPD within control limits. See Table 4	Evaluate data to determine source for error. If analytical error is suspected, reanalyze or reprocess as appropriate.
Field Reagent Blank	Per client sample set	Non-DW: < RL for all target analytes	Analysis only required if samples contain target analytes at or above the RL. If analytes are present in the FRB at >1/3 RL, all samples must be recollected and re-analyzed.

Table 4: LCS and MS/MSD Control Limits*

Analyte	Water (Low Level) %R	Water (Med-High Level) %R	RPD
Perfluorobutanoic acid (PFBA)	50-150	70-130	20
Perfluoropentanoic acid (PFPeA)	50-150	70-130	20
Perfluorobutanesulfonic acid (PFBS)	50-150	70-130	20
Perfluorohexanoic acid (PFHxA)	50-150	70-130	20
Perfluoropentanesulfonic acid (PFPeS)	50-150	70-130	20
Perfluoroheptanoic acid (PFHpA)	50-150	70-130	20
Perfluorohexanesulfonic acid (PFHxS)	50-150	70-130	20
Perfluorooctanoic acid (PFOA)	50-150	70-130	20
Perfluoroheptanesulfonic acid (PFHpS)	50-150	70-130	20
Perfluorononanoic acid (PFNA)	50-150	70-130	20
Perfluorooctanesulfonic acid (PFOS)	50-150	70-130	20
Perfluorodecanoic acid (PFDA)	50-150	70-130	20
Perfluorononanesulfonic acid (PFNS)	50-150	70-130	20
Perfluoroundecanoic acid (PFUdA)	50-150	70-130	20
Perfluorodecanesulfonic acid (PFDS)	50-150	70-130	20
Perfluorooctanesulfonamide (FOSA)	50-150	70-130	20
Perfluorododecanoic acid (PFDoA)	50-150	70-130	20
Perfluorododecanesulfonic acid (PFDoS)	50-150	70-130	20
Perfluorotridecanoic acid (PFTrDA)	50-150	70-130	20
Perfluorotetradecanoic acid (PFTeDA)	50-150	70-130	20
Perfluorohexadecanoic acid (PFHxDA)	50-150	70-130	20
Perfluorooctadecanoic acid (PFODA)	50-150	70-130	20
1H,1H,2H,2H Perfluorohexanesulfonate (4:2FTS)	50-150	70-130	20

1H,1H,2H,2H Perfluorooctanesulfonate (6:2FTS)	50-150	70-130	20
1H,1H,2H,2H Perfluorodecanesulfonate (8:2FTS)	50-150	70-130	20
1H,1H,2H,2H Perfluorododecanesulfonate (10:2FTS)	50-150	70-130	20
N-Methyl Perfluorooctane sulfonamidoacetic acid (N-MeFOSAA)	50-150	70-130	20
N-Ethyl Perfluorooctane sulfonamidoacetic acid (N-EtFOSAA)	50-150	70-130	20
Hexafluoropropylene oxide dimer acid	50-150	70-130	20
4,8-dioxa-3H-perfluorononanoic acid	50-150	70-130	20
9-chlorohexadecafluoro-3-oxanonane-1-sulfonic acid	50-150	70-130	20
11-chloroeicosafluoro-3-oxaundecane-1-sulfonic acid	50-150	70-130	20

**The limits in this table are those in effect as of the published date of this SOP. The %R limits are specified by EPA 537r1.1 in sections 9.33, 9.36, and 9.37. The RPD the lab uses is more strict than those referenced in EPA 537 r1.1. If the lab makes changes to any of these limits, the updated limits will be no less strict than those specified in EPA537.*

Appendix A: Terms and Definitions

PFCAs: Perfluorocarboxylic acids
PFSAs: Perfluorinated sulfonic acids
FOSA: Perfluorinated sulfonamide
PFOA: Perfluorooctanoic acid
PFOS: Perfluorooctane sulfonate
PTFE: Polytetrafluoroethylene (e.g., Teflon®)
SPE: Solid phase extraction**.**
PP: Polypropylene
PE: Polyethylene
HDPE: High density polyethylene
AFFF: Aqueous Film Forming Foam
IDA: Isotope dilution analytes
Acceptance Criteria: specified limits placed on characteristics of an item, process or service defined in requirement documents.
Accuracy: the degree of agreement between an observed value and an accepted reference value. Accuracy includes a combination of random error (precision) and systematic error (bias) components which are due to sampling and analytical operations; a data quality indicator.
Analyte: The specific chemicals or components for which a sample is analyzed. (EPA Risk Assessment Guide for Superfund, OSHA Glossary).
Batch: environmental samples that are prepared and/or analyzed together with the same process, using the same lot(s) of reagents. A preparation/digestion batch is composed of one to 20 environmental samples of similar matrix, meeting the above criteria. An analytical batch is composed of prepared environmental samples (extracts, digestates and concentrates), which are analyzed together as a group.
Calibration: a set of operations that establish, under specified conditions, the relationship between values of quantities indicated by a measuring instrument or measuring system, or values represented by a material measure or a reference material and the corresponding values realized by the standards.
Calibration Curve: the graphical relationship between the known values or a series of calibration standards and their instrument response.
Calibration Standard: A substance or reference used to calibrate an instrument.
Continuing Calibration Verification (CCV): a single or multi-parameter calibration standard used to verify the stability of the method over time. Usually from the same source as the calibration curve.
Corrective Action: the action taken to eliminate the cause of an existing nonconformity, defect or other undesirable occurrence in order to prevent recurrence.
Data Qualifier: a letter designation or symbol appended to an analytical result used to convey information to the data user. (Laboratory)
Demonstration of Capability (DOC): procedure to establish the ability to generate acceptable accuracy and precision.
Holding Time: the maximum time that a sample may be held before preparation and/or analysis as promulgated by regulation or as specified in a test method.
Initial Calibration: Analysis of analytical standards for a series of different specified concentrations used to define the quantitative response, linearity and dynamic range of the instrument to target analytes.
Intermediate Standard: a solution made from one or more stock standards at a concentration between the stock and working standard. Intermediate standards may be certified stock standard solutions purchased from a vendor and are also known as secondary standards.

Laboratory Control Sample (LCS): a blank matrix spiked with a known amount of analyte(s) processed simultaneously with and under the same conditions as samples through all steps of the procedure.
Matrix Spike (MS): a field sample to which a known amount of target analyte(s) is added.
Matrix Spike Duplicate (MSD): a second replicate matrix spike
Method Blank (MB): a blank matrix processed simultaneously with and under the same conditions as samples through all steps of the procedure. Also known as the preparation blank (PB).
Method Detection Limit (MDL): the minimum amount of a substance that can be measured with a specified degree of confidence that the amount is greater than zero using a specific measurement system. The MDL is a statistical estimation at a specified confidence interval of the concentration at which relative uncertainty is ±100%. The MDL represents a range where qualitative detection occurs. Quantitative results are only produced in this range and qualified with the proper data reporting flag when a project requires this type of data reporting.
Non-conformance: an indication, judgment, or state of not having met the requirements of the relevant specification, contract or regulation.
Precision: the degree to which a set of observations or measurements of the same property, obtained under similar conditions, conform to themselves.
Preservation: refrigeration and/or reagents added at the time of sample collection to maintain the chemical, physical, and/or biological integrity of the sample.
Quality Control Sample (QC): a sample used to assess the performance of all or a portion of the measurement system.
Reporting Limit (RL): the level to which data is reported for a specific test method and/or sample.
Stock Standard: a solution made with one or more neat standards usually with a high concentration. Also known as a primary standard. Stock standards may be certified solutions purchased from a vendor.
Surrogate: a substance with properties that mimic the analyte of interest but that are unlikely to be found in environmental samples.

Appendix B: Standard Preparation Tables

The standard formulations contained in this appendix are recommended and are subject to change. If the concentration of the stock standard is different than those noted in this table, adjust the standard preparation formulation accordingly. Unless otherwise specified, prepare the standard solutions in methanol using Class A volumetric glassware and Hamilton syringes and assign an expiration date of 1 year from date of preparation unless the parent standard expires sooner; then use the earlier date. See laboratory SOP BR-QA-002 *Standard Preparation* for further guidance. For stock standards solutions made from neat material, assign an expiration date of 2 years from the date of formulation.

Stock Standard Solutions

PFAS LCS/Matrix Spike Stock Solution 1000 ng/mL

Parent Standard	Vendor	Component	Stock Standard Conc (µg/mL)	Volume Added (µL)	Final Volume (mL)	Final Conc (ng/mL)
PFBA	Wellington Laboratories Code: PFBA	Perfluorobutanoic acid	50	200	10	1000
PFPeA	Wellington Laboratories Code: PFPeA	Perfluoropentanoic acid	50	200		1000
PFBS	Wellington Laboratories Code: L-PFBS	Perfluorobutanesulfonic acid	44.2	200		884
PFHxA	Wellington Laboratories Code: PFHxA	Perfluorohexanoic acid	50	200		1000
PFPeS	Wellington Laboratories Code: L-PFPeS	Perfluoropentanesulfonic acid	46.9	200		938
PFHpA	Wellington Laboratories Code: PFHpA	Perfluoroheptanoic acid	50	200		1000
PFHxSK	Wellington Laboratories Code: br-PFHxSK	Perfluorohexanesulfonic acid	45.5	200		910
PFOA	Wellington Laboratories Code: PFOA	Perfluorooctanoic acid	50	200		1000
PFHpS	Wellington Laboratories Code: L-PFHpS	Perfluoroheptanesulfonic acid	47.6	200		952
PFNA	Wellington Laboratories Code: PFNA	Perfluorononanoic acid	50	200		1000
PFOS	Wellington Laboratories Code: br-PFOSK	Perfluorooctanesulfonic acid	46.4	200		928
PFDA	Wellington Laboratories Code: PFDA	Perfluorodecanoic acid	50	200		1000
PFNS	Wellington Laboratories Code: L-PFNS	Perfluorononanesulfonic acid	48.0	200		960
PFUdA	Wellington Laboratories Code: PFUdA	Perfluoroundecanoic acid	50	200		1000
PFDS	Wellington Laboratories Code: L-PFDS	Perfluorodecanesulfonic acid	48.2	200		964
FOSA	Wellington Laboratories Code: FOSA-I	Perfluorooctane sulfonamide	50	200		1000
PFDoA	Wellington Laboratories Code: PFDoA	Perfluorododecanoic acid	50	200		1000
PFDoS	Wellington Laboratories Code: L-PFDoS	Perfluorododecanesulfonic acid	48.4	200		968
PFTrDA	Wellington Laboratories Code: PFTrDA	Perfluorotridecanoic acid	50	200		1000
PFTeDA	Wellington Laboratories Code: PFTeDA	Perfluorotetradecanoic acid	50	200		1000
PFHxDA	Wellington Laboratories Code: PFHxDA	Perfluorohexadecanoic acid	50	200		1000
PFODA	Wellington Laboratories Code: PFODA	Perfluorooctadecanoic acid	50	200		1000
4:2FTS	Wellington Laboratories Code: 4:2FTS	1H,1H,2H,2H-perfluorohexane sulfonate (4:2)	46.7	200		934
6:2FTS	Wellington Laboratories Code: 6:2FTS	1H,1H,2H,2H-perfluorooctane sulfonate (6:2)	47.4	200		948

8:2FTS	Wellington Laboratories Code: 8:2FTS	1H,1H,2H,2H-perfluorodecane sulfonate (8:2)	47.9	200		958
10:2FTS	Wellington Laboratories Code: 10:2FTS	1H,1H,2H,2H-perfluorododecane sulfonate (10:2)	48.2	200		964
NMeFOSAA	Wellington Laboratories Code: br-NMeFOSAA	N-methyl Perfluorooctane sulfonamidoacetic acid	50	200		1000
NEtFOSAA	Wellington Laboratories Code: br-NEtFOSAA	N-ethyl Perfluorooctane sulfonamidoacetic acid	50	200		1000
HFPO-DA	Wellington Laboratories Code: HFPO-DA	Hexafluoropropylene oxide dimer acid	50	200		1000
DONA	Wellington Laboratories Code: NaDONA	4,8-dioxa-3H-perfluorononanoic acid	47.1	200		942
9Cl-PF3ONS	Wellington Laboratories Code: 9Cl-PF3ONS	9-Chlorohexadecafluoro-3-oxanone-1-sulfonate	46.6	200		932
11Cl-PF3OUdS	Wellington Laboratories Code: 11Cl-PF3OUdS	11-Chloroeicosafluoro-3-oxaundecane-1-sulfonate	47.1	200		942

Solvent: Methanol

PFAS Matrix Spike Solution 400 ng/mL

Parent Standard	Vendor	Component	Stock Standard Conc (ng/mL)	Volume Added (mL)	Final Volume (mL)	Final Conc (ng/mL)
PFAS Matrix Spike Stock Solution	In-house	See above list	1000	2.0	5.0	400

Solvent: Methanol

PFAS MDL Spiking Solution 100 ng/mL

Parent Standard	Vendor	Component	Stock Standard Conc (ng/mL)	Volume Added (mL)	Final Volume (mL)	Final Conc (ng/mL)
PFAS Matrix Spike Stock Solution	In-house	See above list	1000	0.10	1.0	100

Solvent: Methanol

PFAS-IDA Solution (Surrogate) 500 ng/mL

Parent Standard	Vendor	Component	Stock Standard Conc (µg/mL)	Volume Added (µL)	Final Volume (mL)	Final Conc (ng/mL)
13C4 PFBA	Wellington Laboratories Code: MPFBA	$^{13}C_4$-Perfluorobutanoic acid	50	200		500
13C5-PFPeA	Wellington Laboratories Code: MPFPeA	$^{13}C_5$-Perfluoropentanoic acid	50	200		500
13C3-PFBS	Wellington Laboratories Code: M3PFBS	$^{13}C_3$-Perfluorobutanesulfonic acid	46.5	200		465
13C2 PFHxA	Wellington Laboratories Code: MPFHxA	$^{13}C_2$-Perfluorohexanoic acid	50	200		500
13C4 PFHpA	Wellington Laboratories Code: M4PFHpA	$^{13}C_4$-Perfluoroheptanoic acid	50	200		500
18O2 PFHxS	Wellington Laboratories Code: MPFHxS	$^{18}O_2$-Perfluorohexanesulfonic acid	47.3	200	20	473
13C4 PFOA	Wellington Laboratories Code: MPFOA	$^{13}C_4$-Perfluorooctanoic acid	50.0	200		500
13C5 PFNA	Wellington Laboratories Code: MPFNA	$^{13}C_5$-Perfluorononanoic acid	50.0	200		500
13C4 PFOS	Wellington Laboratories Code: MPFOS	$^{13}C_4$-Perfluorooctanesulfonic acid	47.8	200		478
13C2 PFDA	Wellington Laboratories Code: MPFDA	$^{13}C_2$-Perfluorodecanoic acid	50.0	200		500
13C8 FOSA	Wellington Laboratories Code: M8FOSA-I	$^{13}C_8$-Perfluorooctane sulfonamide	50.0	200		500

13C2 PFUdA	Wellington Laboratories Code: MPFUdA	$^{13}C_2$-Perfluoroundecanoic acid	50.0	200		500
13C2 PFDoA	Wellington Laboratories Code: MPFDoA	$^{13}C_2$-Perfluorododecanoic acid	50.0	200		500
13C2 PFTeDA	Wellington Laboratories Code: MPFTeDA	$^{13}C_2$-Perfluorotetradecanoic acid	50.0	200		500
13C2 PFHxDA	Wellington Laboratories Code: MPFHxDA	$^{13}C_2$-Perfluorohexadecanoic acid	50.0	200		500
M2-4:2FTS	Wellington Laboratories Code: M2-4:2FTS	Sodium 1H,1H,2H,2H-perfluoro-1-[1,2-$^{13}C_2$]-hexane sulfonate (4:2)	46.7	200		467
M2-6:2FTS	Wellington Laboratories Code: M2-6:2FTS	Sodium 1H,1H,2H,2H-perfluoro-1-[1,2-$^{13}C_2$]-octane sulfonate (6:2)	47.5	200		475
M2-8:2FTS	Wellington Laboratories Code: M2-8:2FTS	Sodium 1H,1H,2H,2H-perfluoro-1-[1,2-$^{13}C_2$]-decane sulfonate (8:2)	47.9	200		479
d3-NMeFOSAA	Wellington Laboratories Code: d3-M-MeFOSAA	N-methyl-d_3-perfluoro-1-octane sulfonamidoacetic acid	50.0	200		500
d5-NEtFOSAA	Wellington Laboratories Code: d5-M-EtFOSAA	N-ethyl-d_5-perfluoro-1-octane sulfonamidoacetic acid	50.0	200		500
M3HFPO-DA	Wellington Laboratories Code: M3HFPO-DA	$^{13}C_3$-Hexafluoropropylene oxide dimer acid	50.0	200		500

Solvent: Methanol

PFAS Internal Standard Stock Solution 5000 ng/mL

Parent Standard	Vendor	Component	Stock Standard Conc (µg/mL)	Volume Added (µL)	Final Volume (mL)	Final Conc (ng/mL)
13C2 PFOA	Wellington Laboratories Code: M2PFOA	$^{13}C_2$-Perfluorooctanoic acid	50.0	400	4	5000

Solvent: Methanol

PFAS Internal Standard Spiking Solution 1250 ng/mL

Parent Standard	Vendor	Component	Stock Standard Conc (µg/mL)	Volume Added (mL)	Final Volume (mL)	Final Conc (ng/mL)
PFAS Internal Standard Stock Solution	In-house	$^{13}C_2$-Perfluorooctanoic acid	5.0	2.0	8.0	1250

Solvent: Methanol

PFAS-IDA-IS Calibration Standards Level 1-Level 6

ICAL Level	Vol of PFAS LCS/Matrix Spike Stock (µL)	Vol of PFAS MDL Spiking Solution (µL)	Nominal Conc of PFAS (ng/mL)	Vol of PFAS-IDA Solution (µL)	Conc of IDA (ng/mL)	Vol of 0.5ppm PFAS-IS Stock Solution (µL)	Conc of IS (ng/mL)	Vol of 80/20 MeOH/H2O (µL)	Final Vol (mL)
1	0	2	0.050	10	1.25	4	1.25	3988	4.0
2	0	2	0.10	5	1.25	2	1.25	1993	2.0
3	0	10	0.50	5	1.25	2	1.25	1985	2.0
4	12	0	1.0	30	1.25	12	1.25	11958	12.0
5	30	0	2.5	30	1.25	12	1.25	11940	12.0
6	20	0	10.0	5	1.25	2	1.25	1975	2.0

The solvent is 80/20 Methanol/Water.

Appendix C: Equations

Initial Calibration Curve Evaluation:

The linear curve uses the following function:

Equation 1

$$y = bx + c$$

Where:

y = $\frac{\text{Area (analyte)}}{\text{Area (IS)}} \times \text{Concentration (IS)}$

x = concentration
b = slope
c = intercept

The quadratic curve uses the following function:

Equation 2

$$y = ax^2 + bx + c$$

Where y, x, b, and c are the same as above, and a = curvature.

The external standard method uses the following equation:

Equation 3

$$ResponseFactor = \frac{Peak\ Area}{Concentration\ of\ Solution (ng/mL)}$$

Equation 4

$$\text{Concentration, ng/mL} = \frac{y - c}{b}$$

Equation 5

$$\text{Concentration, ng/mL} = \frac{-b + \sqrt{b^2 - 4a(c - y)}}{2a}$$

Where:

y = $\frac{\text{Area (analyte)}}{\text{Area (IS)}} \times \text{Concentration (IS)}$

x = concentration
a = curvature
b = slope
c = intercept

Water Sample Result Calculation:

Equation 6

$$\text{Concentration, ng/L} = \frac{C_{ex} V_t}{V_o}$$

Where:

C_{ex} = Concentration measured in sample extract (ng/mL)
V_t = Volume of total extract (mL)
V_o = Volume of water extracted (L)

IDA Recovery Calculation:

Equation 8

$$\%\,\mathrm{Recovery} = \frac{A_t Q_{is}}{A_{is} Q_t RRF_{IDA}} X 100$$

Where ng/g = µg/kg and:

RF_{IDA} = Response Factor for IDA compound
A_t = Area response for IDA compound
A_{IS} = Area Response for IS compound
Q_{IS} = Amount of IS added
Q_t = Amount of IDA added

Calibration Factor (CF_x) = Peak area or height $_{(x)}$ / Standard concentration $_{(\mu g/L)}$

Mean Calibration Factor ($\overline{CF}$) = $\frac{\sum_{i=1}^{n} CF_i}{n}$

where: n = number of calibration levels

Standard Deviation of the Calibration Factor (SD) = $\sqrt{\frac{\sum_{i=1}^{n}\left(CF_i - \overline{CF}\right)2}{n-1}}$

where: n = number of calibration levels

Percent Relative Standard Deviation (RSD) of the Calibration Factor = $\frac{SD}{\overline{CF}} \times 100\%$

Percent Difference (%D) = $\frac{CF_v - \overline{CF}}{\overline{CF}} \times 100\%$

where: CF_v = Calibration Factor from the Continuing Calibration Verification (CCV)

Percent Drift = Calculated Concentration – Theoretical Concentration / Theoretical Concentration x 100%

Percent Recovery (%R) = $\frac{C_s}{C_n} \times 100\%$

where: C_s = Concentration of the Spiked Field or QC Sample
C_n = Nominal Concentration of Spike Added

Percent Recovery (%R) for MS/MSD = $\frac{C_s - C_u}{C_n} \times 100\%$

where: C_s = Concentration of the Spiked Sample
C_u = Concentration of the Unspiked Sample
C_n = Nominal Concentration of Spike Added

Relative Percent Difference (%RPD) = $\frac{|C_1 - C_2|}{\left(\frac{C_1 + C_2}{2}\right)} \times 100\%$

where: C_1 = Measured Concentration of First Sample
C_2 = Measured Concentration of Second Sample

Sample Concentration

Extract

$C_{extract}$ (µg/L) = $\frac{\text{Peak Area (or Height)}}{\overline{CF}}$

Note: The concentrations of the 3-5 peaks chosen for quantificaton is calculated and the average is then taken for final calculation.

Appendix D: Analytes applied for Secondary Certification with NJDEP

Compound Name	Abbreviation	CAS #
Perfluorobutanoic acid	PFBA	375-22-4
Perfluoropentanoic acid	PFPeA	2706-90-3
Perfluorohexanoic acid	PFHxA	307-24-4
Perfluoroheptanoic acid	PFHpA	375-85-9
Perfluorooctanoic acid	PFOA	335-67-1
Perfluorononanoic acid	PFNA	375-95-1
Perfluorodecanoic acid	PFDA	335-76-2
Perfluoroundecanoic acid	PFUdA (PFUnA)	2058-94-8
Perfluorododecanoic acid	PFDoA	307-55-1
Perfluorotridecanoic acid	PFTrDA	72629-94-8
Perfluorotetradecanoic acid	PFTeDA (PFTA)	376-06-7
Perfluorobutanesulfonic acid	PFBS	375-73-5
Perfluorohexanesulfonic acid	PFHxS	355-46-4
Perfluorooctanesulfonic acid	PFOS	1763-23-1

NEW YORK STATE OF OPPORTUNITY. Department of Health

ANDREW M. CUOMO
Governor

HOWARD A. ZUCKER, M.D., J.D.
Commissioner

LISA J. PINO, M.A., J.D.
Executive Deputy Commissioner

LAB ID: 10391

December 21, 2020

MS. KRISTINE A. DUSABLON
EUROFINS TESTAMERICA BURLINGTON
530 COMMUNITY DRIVE
SUITE #11
SOUTH BURLINGTON, VT 05403

Certificate Expiration Date:
April 01, 2021

Dear Ms. Dusablon,

Enclosed are revised certificate(s) of approval issued to your environmental laboratory for the current permit year. The certificate(s) supersede(s) any previously issued one(s) and are in effect through the expiration date listed. Please carefully examine the certificate(s) to insure that the categories, subcategories, analytes, and methods for which your laboratory is approved are correct. In addition, verify that your laboratory's name, address, lead technical director, and identification number are accurate.

Pursuant to NYCRR Subpart 55-2.2, original certificates must be posted conspicuously in the laboratory and copies shall be made available to any client of the laboratory upon request.

Pursuant to NYCRR Subpart 55-2.6, any misrepresentation of the fields of accreditation (category - method - analyte) for which your laboratory is approved may result in denial, suspension, or revocation of your certification. Any use of the Environmental Laboratory Approval Program (ELAP) or National Environmental Laboratory Accreditation Program (NELAP) name, reference to the laboratory's approval status, and/or using the NELAP logo in any catalogs, advertising, business solicitations, proposals, quotations, laboratory analytical reports, or other materials must include the laboratory's ELAP identification number and distinguish between testing for which the laboratory is approved and testing for which the laboratory is not approved.

If the changes to your certificate are due to insufficient proficiency tests and/or proficiency test failures, the expired certificates (listed below) must be returned to the ELAP office within 10 days of the date of this letter. In addition, your laboratory must investigate the root cause for any insufficient and/or unsatisfactory proficiency tests and keep this on file for review during an onsite assessment. Also, the laboratory must provide a corrective action report to ELAP within 30 calendar days of a request by the program.

If you have any questions, please contact us at the Environmental Laboratory Approval Program, Wadsworth Center, New York State Department of Health, Empire State Plaza, Albany NY, 12237; by phone at (518) 485-5570; by facsimile at (518) 485-5568; and by email at elap@health.ny.gov.

Expired Certificates:
61075 PW NELAC
61076 PW ELAP
61077 NW NELAC
61078 SW NELAC
61079 AI NELAC

Sincerely,

Victoria Pretti

Victoria Pretti
Director and QA Officer
Environmental Laboratory Approval Program

NEW YORK STATE OF OPPORTUNITY. Department of Health

ANDREW M. CUOMO
Governor

HOWARD A. ZUCKER, M.D., J.D.
Commissioner

LISA J. PINO, M.A., J.D.
Executive Deputy Commissioner

LAB ID: 10391

December 21, 2020

MS. KRISTINE A. DUSABLON
EUROFINS TESTAMERICA BURLINGTON
530 COMMUNITY DRIVE
SUITE #11
SOUTH BURLINGTON, VT 05403

Dear Ms. Dusablon,

A revised certificate has been generated because of the change(s) listed below.

If your laboratory has applied for a change in the laboratory's location and/or technical director, the approved change(s) will be reflected on the certificate.

If the changes to your certification are due to insufficient proficiency tests and/or proficiency test failures, the expired certificates must be returned to the Environmental Laboratory Approval Program (ELAP) office within 10 days of the date of this letter. In addition, your laboratory must investigate the root cause for any insufficient and/or unsatisfactory proficiency tests and keep this on file for review during an onsite assessment. Also, the laboratory must provide a corrective action report to ELAP within 30 calendar days of a request by the program.

In addition, your laboratory must investigate and document the root cause for any insufficient and/or unsatisfactory proficiency tests. If your lab lost accreditation due to two PT failures, you must submit the corrective action response to ELAP for review before accreditation will be re-instated.

AppCat	Analyte Name	Method Name	Comments	Date
AI - NELAC			Lab Address Changed	12/21/2020
NW - NELAC			Lab Address Changed	12/21/2020
PW			Lab Address Changed	12/21/2020
PW - NELAC			Lab Address Changed	12/21/2020
SW - NELAC			Lab Address Changed	12/21/2020

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised December 21, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. KRISTINE A. DUSABLON
EUROFINS TESTAMERICA BURLINGTON
530 COMMUNITY DRIVE SUITE #11
SOUTH BURLINGTON, VT 05403

NY Lab Id No: 10391

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2016) for the category ENVIRONMENTAL ANALYSES AIR AND EMISSIONS
All approved analytes are listed below:

Acrylates	
Acetonitrile	EPA TO-15
Methyl methacrylate	EPA TO-15
Chlorinated Hydrocarbons	
1,2,4-Trichlorobenzene	EPA TO-15
Hexachlorobutadiene	EPA TO-15
Polychlorinated Biphenyls	
PCBs and Aroclors	EPA TO-10A
	EPA TO-4A
Polynuclear Aromatics	
Acenaphthene	EPA TO-13A
Acenaphthylene	EPA TO-13A
Anthracene	EPA TO-13A
Benzo(a)anthracene	EPA TO-13A
Benzo(a)pyrene	EPA TO-13A
Benzo(b)fluoranthene	EPA TO-13A
Benzo(g,h,i)perylene	EPA TO-13A
Benzo(k)fluoranthene	EPA TO-13A
Chrysene	EPA TO-13A
Dibenzo(a,h)anthracene	EPA TO-13A
Fluoranthene	EPA TO-13A
Fluorene	EPA TO-13A
Indeno(1,2,3-cd)pyrene	EPA TO-13A
Naphthalene	EPA TO-13A
	EPA TO-15

Polynuclear Aromatics	
Phenanthrene	EPA TO-13A
Pyrene	EPA TO-13A
Purgeable Aromatics	
1,2,4-Trimethylbenzene	EPA TO-15
1,2-Dichlorobenzene	EPA TO-15
1,3,5-Trimethylbenzene	EPA TO-15
1,3-Dichlorobenzene	EPA TO-15
1,4-Dichlorobenzene	EPA TO-15
2-Chlorotoluene	EPA TO-15
Benzene	EPA TO-15
Chlorobenzene	EPA TO-15
Ethyl benzene	EPA TO-15
m/p-Xylenes	EPA TO-15
o-Xylene	EPA TO-15
Styrene	EPA TO-15
Toluene	EPA TO-15
Total Xylenes	EPA TO-15
Purgeable Halocarbons	
1,1,1-Trichloroethane	EPA TO-15
1,1,2,2-Tetrachloroethane	EPA TO-15
1,1,2-Trichloro-1,2,2-Trifluoroethane	EPA TO-15
1,1,2-Trichloroethane	EPA TO-15
1,1-Dichloroethane	EPA TO-15
1,1-Dichloroethene	EPA TO-15
1,2-Dibromoethane	EPA TO-15

Serial No.: 62336

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised December 21, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. KRISTINE A. DUSABLON
EUROFINS TESTAMERICA BURLINGTON
530 COMMUNITY DRIVE SUITE #11
SOUTH BURLINGTON, VT 05403

NY Lab Id No: 10391

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2016) for the category ENVIRONMENTAL ANALYSES AIR AND EMISSIONS
All approved analytes are listed below:

Purgeable Halocarbons	
1,2-Dichloroethane	EPA TO-15
1,2-Dichloropropane	EPA TO-15
3-Chloropropene (Allyl chloride)	EPA TO-15
Bromodichloromethane	EPA TO-15
Bromoform	EPA TO-15
Bromomethane	EPA TO-15
Carbon tetrachloride	EPA TO-15
Chloroethane	EPA TO-15
Chloroform	EPA TO-15
Chloromethane	EPA TO-15
cis-1,2-Dichloroethene	EPA TO-15
cis-1,3-Dichloropropene	EPA TO-15
Dibromochloromethane	EPA TO-15
Dichlorodifluoromethane	EPA TO-15
Methylene chloride	EPA TO-15
Tetrachloroethene	EPA TO-15
trans-1,2-Dichloroethene	EPA TO-15
trans-1,3-Dichloropropene	EPA TO-15
Trichloroethene	EPA TO-15
Trichlorofluoromethane	EPA TO-15
Vinyl bromide	EPA TO-15
Vinyl chloride	EPA TO-15

Volatile Chlorinated Organics	
Benzyl chloride	EPA TO-15

Volatile Organics	
1,2-Dichlorotetrafluoroethane	EPA TO-15
1,3-Butadiene	EPA TO-15
1,4-Dioxane	EPA TO-15
2,2,4-Trimethylpentane	EPA TO-15
2-Butanone (Methylethyl ketone)	EPA TO-15
4-Methyl-2-Pentanone	EPA TO-15
Acetone	EPA TO-15
Carbon Disulfide	EPA TO-15
Cyclohexane	EPA TO-15
Hexane	EPA TO-15
Isopropanol	EPA TO-15
Methyl tert-butyl ether	EPA TO-15
n-Heptane	EPA TO-15
tert-butyl alcohol	EPA TO-15

Serial No.: 62336

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised December 21, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. KRISTINE A. DUSABLON
EUROFINS TESTAMERICA BURLINGTON
530 COMMUNITY DRIVE SUITE #11
SOUTH BURLINGTON, VT 05403

NY Lab Id No: 10391

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2016) for the category ENVIRONMENTAL ANALYSES SOLID AND HAZARDOUS WASTE
All approved analytes are listed below:

Characteristic Testing	
Synthetic Precipitation Leaching Proc.	EPA 1312
TCLP	EPA 1311
Metals I	
Barium, Total	EPA 6010D
	EPA 6020B
Cadmium, Total	EPA 6010D
	EPA 6020B
Calcium, Total	EPA 6010D
	EPA 6020B
Chromium, Total	EPA 6010D
	EPA 6020B
Copper, Total	EPA 6010D
	EPA 6020B
Iron, Total	EPA 6010D
	EPA 6020B
Lead, Total	EPA 6010D
	EPA 6020B
Magnesium, Total	EPA 6010D
	EPA 6020B
Manganese, Total	EPA 6010D
	EPA 6020B
Nickel, Total	EPA 6010D
	EPA 6020B
Potassium, Total	EPA 6010D
	EPA 6020B
Metals I	
Silver, Total	EPA 6010D
	EPA 6020B
Sodium, Total	EPA 6010D
	EPA 6020B
Strontium, Total	EPA 6010D
Metals II	
Aluminum, Total	EPA 6010D
	EPA 6020B
Antimony, Total	EPA 6010D
	EPA 6020B
Arsenic, Total	EPA 6010D
	EPA 6020B
Beryllium, Total	EPA 6010D
	EPA 6020B
Mercury, Total	EPA 7471B
Selenium, Total	EPA 6010D
	EPA 6020B
Vanadium, Total	EPA 6010D
	EPA 6020B
Zinc, Total	EPA 6010D
	EPA 6020B
Metals III	
Cobalt, Total	EPA 6010D
	EPA 6020B
Molybdenum, Total	EPA 6010D

Serial No.: 62335

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised December 21, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. KRISTINE A. DUSABLON
EUROFINS TESTAMERICA BURLINGTON
530 COMMUNITY DRIVE SUITE #11
SOUTH BURLINGTON, VT 05403

NY Lab Id No: 10391

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2016) for the category ENVIRONMENTAL ANALYSES SOLID AND HAZARDOUS WASTE
All approved analytes are listed below:

Metals III

Molybdenum, Total	EPA 6020B
Thallium, Total	EPA 6010D
	EPA 6020B
Tin, Total	EPA 6010D
Titanium, Total	EPA 6010D

Miscellaneous

Organic Carbon, Total	USER DEFINED Lloyd Kahn mod
Perchlorate	EPA 6850

Nitroaromatics and Isophorone

1,3,5-Trinitrobenzene	EPA 8330B
1,3-Dinitrobenzene	EPA 8330B
2,4,6-Trinitrotoluene	EPA 8330B
2,4-Dinitrotoluene	EPA 8330B
2,6-Dinitrotoluene	EPA 8330B
2-Amino-4,6-dinitrotoluene	EPA 8330B
2-Nitrotoluene	EPA 8330B
3-Nitrotoluene	EPA 8330B
4-Amino-2,6-dinitrotoluene	EPA 8330B
4-Nitrotoluene	EPA 8330B
Hexahydro-1,3,5-trinitro-1,3,5-triazine	EPA 8330B
Methyl-2,4,6-trinitrophenylnitramine	EPA 8330B
Nitrobenzene	EPA 8330B
Octahydro-tetranitro-tetrazocine	EPA 8330B

Polychlorinated Biphenyls

Aroclor 1016 (PCB-1016)	EPA 8082A
Aroclor 1221 (PCB-1221)	EPA 8082A
Aroclor 1232 (PCB-1232)	EPA 8082A
Aroclor 1242 (PCB-1242)	EPA 8082A
Aroclor 1248 (PCB-1248)	EPA 8082A
Aroclor 1254 (PCB-1254)	EPA 8082A
Aroclor 1260 (PCB-1260)	EPA 8082A
Aroclor 1262 (PCB-1262)	EPA 8082A
Aroclor 1268 (PCB-1268)	EPA 8082A

Sample Preparation Methods

EPA 3050B
EPA 3550C
EPA 3540C
EPA 3541

Serial No.: 62335

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised December 21, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. KRISTINE A. DUSABLON
EUROFINS TESTAMERICA BURLINGTON
530 COMMUNITY DRIVE SUITE #11
SOUTH BURLINGTON, VT 05403

NY Lab Id No: 10391

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2016) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Dissolved Gases	
Ethane	RSK-175
Ethene (Ethylene)	RSK-175
Methane	RSK-175
Metals I	
Barium, Total	EPA 6010D
	EPA 6020B
Cadmium, Total	EPA 6010D
	EPA 6020B
Calcium, Total	EPA 6010D
	EPA 6020B
Chromium, Total	EPA 6010D
	EPA 6020B
Copper, Total	EPA 6010D
	EPA 6020B
Iron, Total	EPA 6010D
	EPA 6020B
Lead, Total	EPA 6010D
	EPA 6020B
Magnesium, Total	EPA 6010D
	EPA 6020B
Manganese, Total	EPA 6010D
	EPA 6020B
Nickel, Total	EPA 6010D
	EPA 6020B
Potassium, Total	EPA 6010D

Metals I	
Potassium, Total	EPA 6020B
Sodium, Total	EPA 6010D
	EPA 6020B
Strontium, Total	EPA 6010D
Metals II	
Aluminum, Total	EPA 6010D
	EPA 6020B
Arsenic, Total	EPA 6010D
	EPA 6020B
Beryllium, Total	EPA 6010D
	EPA 6020B
Mercury, Total	EPA 7470A
Selenium, Total	EPA 6010D
	EPA 6020B
Vanadium, Total	EPA 6010D
	EPA 6020B
Zinc, Total	EPA 6010D
	EPA 6020B
Metals III	
Cobalt, Total	EPA 6010D
	EPA 6020B
Molybdenum, Total	EPA 6010D
	EPA 6020B
Thallium, Total	EPA 6010D
	EPA 6020B

Serial No.: 62334

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised December 21, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. KRISTINE A. DUSABLON
EUROFINS TESTAMERICA BURLINGTON
530 COMMUNITY DRIVE SUITE #11
SOUTH BURLINGTON, VT 05403

NY Lab Id No: 10391

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2016) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Metals III

Tin, Total	EPA 6010D
Titanium, Total	EPA 6010D

Miscellaneous

Perchlorate	EPA 6850

Nitroaromatics and Isophorone

1,3,5-Trinitrobenzene	EPA 8330B
1,3-Dinitrobenzene	EPA 8330B
2,4,6-Trinitrotoluene	EPA 8330B
2,4-Dinitrotoluene	EPA 8330B
2,6-Dinitrotoluene	EPA 8330B
2-Amino-4,6-dinitrotoluene	EPA 8330B
2-Nitrotoluene	EPA 8330B
3-Nitrotoluene	EPA 8330B
4-Amino-2,6-dinitrotoluene	EPA 8330B
4-Nitrotoluene	EPA 8330B
Hexahydro-1,3,5-trinitro-1,3,5-triazine	EPA 8330B
Methyl-2,4,6-trinitrophenylnitramine	EPA 8330B
Nitrobenzene	EPA 8330B
Octahydro-tetranitro-tetrazocine	EPA 8330B

Polychlorinated Biphenyls

Aroclor 1016 (PCB-1016)	EPA 8082A
Aroclor 1221 (PCB-1221)	EPA 8082A
Aroclor 1232 (PCB-1232)	EPA 8082A
Aroclor 1242 (PCB-1242)	EPA 8082A

Polychlorinated Biphenyls

Aroclor 1248 (PCB-1248)	EPA 8082A
Aroclor 1254 (PCB-1254)	EPA 8082A
Aroclor 1260 (PCB-1260)	EPA 8082A
Aroclor 1262 (PCB-1262)	EPA 8082A
Aroclor 1268 (PCB-1268)	EPA 8082A

Sample Preparation Methods

	EPA 3010A
	EPA 3510C
	EPA 3520C

Serial No.: 62334

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised December 21, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. KRISTINE A. DUSABLON
EUROFINS TESTAMERICA BURLINGTON
530 COMMUNITY DRIVE SUITE #11
SOUTH BURLINGTON, VT 05403

NY Lab Id No: 10391

is hereby APPROVED as an Environmental Laboratory for the category
ENVIRONMENTAL ANALYSES POTABLE WATER
All approved subcategories and/or analytes are listed below:

Perfluorinated Alkyl Acids

Perfluorooctanesulfonic acid (PFOS)	ISO 25101
Perfluorooctanoic acid (PFOA)	ISO 25101

Serial No.: 62333

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised December 21, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. KRISTINE A. DUSABLON
EUROFINS TESTAMERICA BURLINGTON
530 COMMUNITY DRIVE SUITE #11
SOUTH BURLINGTON, VT 05403

NY Lab Id No: 10391

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2016) for the category ENVIRONMENTAL ANALYSES POTABLE WATER
All approved analytes are listed below:

Miscellaneous

Perchlorate	EPA 331.0

Serial No.: 62332

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

Title: Semivolatile Organic Compounds by Gas Chromatography/Mass Spectrometery (GC/MS), SW846 Methods 8270D and 8270E

Once printed, this is considered an uncontrolled document

Approvals (Signature/Date):

Sylvanus Klusey Organics Operations Manager	6/29/2020 Date	Dan Helfrich Health & Safety Manager	6/29/2020 Date
Carl Armbruster Quality Assurance Manager	6/29/2020 Date	Mark Acierno Laboratory Director	6/29/2020 Date

Diaa Nimer — 6/29/2020 Date
SVOA GC/MS Manager

Copyright Information:
This documentation has been prepared by TestAmerica Laboratories, Inc. d/b/a Eurofins TestAmerica and its affiliates ("Eurofins TestAmerica"), solely for their own use and the use of their customers in evaluating their qualifications and capabilities in connection with a particular project. The user of this document agrees by its acceptance to return it to Eurofins TestAmerica upon request and not to reproduce, copy, lend, or otherwise disclose its contents, directly or indirectly, and not to use it for any purpose other than that for which it was specifically provided. The user also agrees not to give access to this document to any third parties including but not limited to consultants, unless such third parties specifically agree to these conditions.

THIS DOCUMENT CONTAINS VALUABLE CONFIDENTIAL AND PROPRIETARY INFORMATION. DISCLOSURE, USE OR REPRODUCTION OF THESE MATERIALS WITHOUT THE WRITTEN AUTHORIZATION OF EUROFINS TESTAMERICA IS STRICTLY PROHIBITED. THIS UNPUBLISHED WORK BY EUROFINS TESTAMERICA IS PROTECTED BY STATE AND FEDERAL LAW OF THE UNITED STATES. IF PUBLICATION OF THIS WORK SHOULD OCCUR THE FOLLOWING NOTICE SHALL APPLY:

©COPYRIGHT 2020 TESTAMERICA LABORATORIES, INC. d/b/a EUROFINS TESTAMERICA ALL RIGHTS RESERVED

Facility Distribution No. : Electronic **Distributed To: Facility Intranet**

1.0 Scope and Application

1.1 Analytes, Matrix(s), and Reporting Limits

USEPA Methods 8270D and 8270E are analytical methods which employ the use of GC/MS to determine the concentration of semivolatile organic compounds in extracts prepared from many types of solid waste matrices, soils, and water samples

TestAmerica Edison has the capability to analyze and report the compounds listed in Table 1 via Methods 8270D and 8270E.

Table 1

Compound	CAS No.	Compound	CAS No.
1,1'-Biphenyl	92-52-4	Anthracene **(1)**	120-12-7
1,2,4,5-Tetrachlorobenzene	95-94-3	Atrazine	1912-24-9
1,2,4-Trichlorobenzene	120-82-1	Benzaldehyde	100-52-7
1,2-Dichlorobenzene	95-50-1	Benzidine	92-87-5
1,2-Diphenylhydrazine	122-66-7	Benzo[a]anthracene **(1)**	56-55-3
1,3-Dichlorobenzene	541-73-1	Benzo[a]pyrene **(1)**	50-32-8
1,3-Dimethylnaphthalene	575-41-7	Benzo[b]fluoranthene **(1)**	205-99-2
1,4-Dichlorobenzene	106-46-7	Benzo[g,h,i]perylene **(1)**	191-24-2
1,4-Dichlorobenzene-d4 **(ISTD)**	3855-82-1	Benzo[k]fluoranthene **(1)**	207-08-9
1,4-Dioxane **(1) (2)**	123-91-1	Benzoic acid	65-85-0
1-Methylnaphthalene	90-12-0	Benzyl alcohol	100-51-6
1-Naphthylamine	134-32-7	Bis(2-chloroethoxy)methane	111-91-1
2,2'-oxybis[1-chloropropane]	108-60-1	Bis(2-chloroethyl)ether **(1)**	111-44-4
2,3,4,6-Tetrachlorophenol	58-90-2	Bis(2-ethylhexyl) phthalate	117-81-7
2,3,7,8-TCDD	1746-01-6	Bisphenol-A	80-05-7
2,3-Dihydroindene	496-11-7	Butyl benzyl phthalate	85-68-7
2,3-Dimethylaniline	87-59-2	Caprolactam	105-60-2
2,4,5-Trichlorophenol	95-95-4	Carbamazepine	298-46-4
2,4,5-Trimethylaniline	137-17-7	Carbazole	86-74-8
2,4,6-Tribromophenol **(Surrogate)**	118-79-6	Chrysene **(1)**	218-01-9
2,4,6-Trichlorophenol	88-06-2	Chrysene-d12 **(ISTD)**	1719-03-5
2,4-Dichlorophenol	120-83-2	Coumarin	91-64-5
2,4-Dimethylphenol	105-67-9	Dibenz(a,h)anthracene **(1)**	53-70-3
2,4-Dinitrophenol	51-28-5	Dibenzofuran	132-64-9
2,4-Dinitrotoluene	121-14-2	Diethyl phthalate	84-66-2
2,4-Xylidine	95-68-1	Dimethyl phthalate	131-11-3
2,6-Dinitrotoluene	606-20-2	Di-n-butyl phthalate	84-74-2
2-Chloronaphthalene	91-58-7	Di-n-octyl phthalate	117-84-0
2-Chlorophenol	95-57-8	Fluoranthene **(1)**	206-44-0
2-Ethylaniline	578-54-1	Fluorene **(1)**	86-73-7
2-Fluorobiphenyl **(Surrogate)**	321-60-8	Hexachlorobenzene **(1)**	118-74-1
2-Fluorophenol **(Surrogate)**	367-12-4	Hexachlorobutadiene	87-68-3
2-Methylnaphthalene	91-57-6	Hexachlorocyclopentadiene	77-47-4
2-Methylphenol	95-48-7	Hexachloroethane	67-72-1
2-Naphthylamine	91-59-8	Indeno[1,2,3-cd]pyrene **(1)**	193-39-5
2-Nitroaniline	88-74-4	Isophorone	78-59-1
2-Nitrophenol	88-75-5	n,n'-Dimethylaniline	121-69-7
2-tertbutyl-4-methylphenol	2409-55-4	Naphthalene **(1)**	91-20-3
2-Toluidine	95-53-4	Naphthalene-d8 **(ISTD)**	1146-65-2

Table 1

Compound	CAS No.	Compound	CAS No.
3 & 4 Methylphenol	15831-10-4	n-Decane	124-18-5
3,3'-Dichlorobenzidine	91-94-1	Nitrobenzene	98-95-3
3,4-Dimethylaniline	95-64-7	Nitrobenzene-d5 **(Surrogate)**	4165-60-0
3,5-di-tert-butyl-4-hydroxytol	128-37-0	N-Nitrosodimethylamine **(1)**	62-75-9
3-Nitroaniline	99-09-2	N-Nitrosodi-n-propylamine	621-64-7
4,6-Dinitro-2-methylphenol **(1)**	534-52-1	N-Nitrosodiphenylamine	86-30-6
4-Bromophenyl phenyl ether	101-55-3	n-Octadecane	593-45-3
4-chloro-2-methylaniline	95-69-2	o-Toluidine-d9 **(Surrogate)**	194423-47-7
4-Chloro-3-methylphenol	59-50-7	Pentachloronitrobenzene	82-68-8
4-Chloroaniline	106-47-8	Pentachlorophenol **(1)**	87-86-5
4-Chloroaniline–d4 **(Surrogate)**	191656-33-4	Perylene-d12 **(ISTD)**	1520-96-3
4-Chlorophenyl phenyl ether	7005-72-3	Phenanthrene **(1)**	85-01-8
4-Methylphenol	106-44-5	Phenanthrene-d10 **(ISTD**)	1517-22-2
4-Nitroaniline	100-01-6	Phenol	108-95-2
4-Nitrophenol	100-02-7	Phenol-d5 **(Surrogate)**	4165-62-2
Acenaphthene **(1)**	83-32-9	Phenyl ether	101-84-8
Acenaphthene-d10 **(ISTD)**	15067-26-2	Pyrene **(1)**	129-00-0
Acenaphthylene **(1)**	208-96-8	Pyridine	110-86-1
Acetophenone	98-86-2	Terphenyl-d14 **(Surrogate)**	1718-51-0
Aniline	62-53-3	Total Cresols	STL00160
Aniline-d5 **(Surrogate)**	4165-61-1		

(1) Compound can be analyzed by full scan or Selected Ion Monitoring (SIM).
(2) Compound can also be analyzed by Isotope Dilution/SIM.

1.2 For a listing of method detection limits (MDLs) and Reporting Limits (RLs) please refer to the currently active Method 8270 Method Limit Groups in TALS (TestAmerica LIMS).

1.3 On occasion clients may request modifications to this SOP. These modifications are handled following the procedures outlined in Section 7 (*Review of Work)*, and Section 19 (*Test Methods and Method Validation)* in TestAmerica Edison's Quality Assurance Manual (TestAmerica Edison Document No. ED-QA-LQM).

1.4 Any variation in procedure shall be completely documented using an NCM. The NCM is approved by the supervisor and then automatically sent to the laboratory Project Manager by e-mail so that the client can be notified as appropriate. The QA department also receives NCMs by e-mail for tracking and trending purposes. The NCM process is described in more detail in SOP ED-GEN-003. The NCM shall be filed in the project file and addressed in the case narrative. Any unauthorized deviations from this procedure must also be documented as a nonconformance, with a cause and corrective action described.

2.0 Summary of Method

2.1 This method is used for the analysis of aqueous and solid matrices for semi-volatile base, neutral and acid organic compounds that are extracted from the sample matrix with an organic solvent.

2.2 An aliquot of sample containing surrogate spiking compounds is extracted with an organic solvent. The extract is concentrated on a steam bath to a suitable volume. Internal standards are added to the extract.

2.3 Sample extraction techniques are specified for each matrix in the following TestAmerica Edison SOPs:

- ED-ORP-002 (*Extraction of Semivolatile Organic Compounds in Water by Separatory Funnel, SW846 Method 3510C*);
- ED-ORP-043 (*SW846 Method 3580A - Waste Dilution Prep for Analysis of BNAs by SW846 Method 8270);*
- ED-ORP-0044 (*Microwave Extraction for Solids, SW846 Method 3546*);

2.4 A small aliquot of the extract is injected into a gas chromatograph (GC) equipped with a capillary column. The GC is temperature programmed to separate the compounds which were recovered during the extraction step by boiling point. The effluent of the gas chromatograph is interfaced to a mass spectrometer (MS) which is used to detect the compounds eluting from the GC. The detected compounds are fragmented with an electron beam to produce a mass spectrum which is characteristic of the compound introduced into the MS. Identification of target analytes is accomplished by comparing their mass spectra with the electron ionization spectra of authentic standards. Quantitation is accomplished by comparing the response of a major ion (quantitation ion) relative to an internal standard established through a five-point calibration (six points for second order regression). Specific calibration and quality control steps are included in the method that must be performed and must meet the specifications of SW846 Methods 8270D or 8270E as applicable.

2.5 The standard preparation procedure for aqueous samples involves use of a Reduced Volume Extraction (250 ml) (RVE) followed by analysis using a Large Volume Injection (LVI). Optionally, a full volume (1000 ml nominal) may be employed. The details of the extractions are outlined in the applicable prep SOPs while the analytical details for 8270D and 8270E are presented in this SOP.

2.6 These methods are also applicable to the analysis of samples by Selected Ion Monitoring (SIM) for the purpose of obtaining lower reporting limits for the following compounds:

Table 2 – SIM Analytes

SIM Analytes	CAS #
1,4-Dioxane	123-91-1
4,6-Dinitro-2-methylphenol	534-52-1
Acenaphthene	83-32-9

Table 2 – SIM Analytes	
SIM Analytes	**CAS #**
Acenaphthylene	208-96-8
Anthracene	120-12-7
Benzo[a]anthracene	56-55-3
Benzo[a]pyrene	50-32-8
Benzo[b]fluoranthene	205-99-2
Benzo[g,h,i]perylene	191-24-2
Benzo[k]fluoranthene	207-08-9
Bis(2-chloroethyl)ether	111-44-4
Chrysene	218-01-9
Dibenz(a,h)anthracene	53-70-3
Fluoranthene	206-44-0
Fluorene	86-73-7
Hexachlorobenzene	118-74-1
Indeno[1,2,3-cd]pyrene	193-39-5
Naphthalene	91-20-3
N-Nitrosodimethylamine	62-75-9
Pentachlorophenol	87-86-5
Phenanthrene	85-01-8
Pyrene	129-00-0

2.7 An isotope dilution selected ion monitoring (SIM) technique for the analysis of 1,4-dioxane in water at a reporting level of 0.4 ug/l is also described in this SOP. Using this technique 1,4-dioxane-d8 is added prior to sample extraction and is used as an internal standard to calculate the concentration of 1,4-dioxane present. Additionally, 1,4-dichorobenzene-d4 is added to the extract prior to analysis to monitor the recovery of 1,4-dioxane-d8.

3.0 Definitions

For a complete list of definitions refer to Appendix 2 in the most current revision of the Quality Assurance Manual (ED-QA-LQM).

4.0 Interferences

4.1 GC/MS data from all blanks, samples, and spikes must be evaluated for interferences. Analysts must take steps to determine the source of the interference and take corrective action to eliminate the problem.

4.1.1 Contamination by carryover can occur whenever high-concentration and low-concentration samples are sequentially analyzed. To reduce

carryover, the sample syringe is automatically rinsed with solvent between sample injections. Whenever an unusually concentrated sample is encountered, it should be followed by the analysis of a solvent blank to check for cross-contamination. Alternately, verify that the sample analyzed after the high concentration sample does not show any carryover through inspection of chromatogram and target results.

4.1.2 Contaminants from the extraction process detected in the method blank should be evaluated to determine the impact on the analysis. Interferences from any target analyte must not be present in the method blank above the reporting limit for that compound. If these types of interferences occur, corrective action is required. The source should be identified and corrective action initiated to eliminate the interference from the extraction process. Affected samples must be re-extracted and re-analyzed.

4.1.3 The analyst must take precautions to make sure that contaminants do not enter the analytical system. These precautions include systematic procedures designed to eliminate interferences.

4.2 Some compounds analyzed by this method are unstable or sensitive to extraction and/or instrument conditions:

- Benzidine is easily oxidized during extraction. Neutral extraction may enhance the recovery of this compound.
- Hexachlorocyclopentadiene breaks down photochemically and can decompose from high temperatures, particularly in the injection port of the GC. This compound can also react with acetone in solution.
- 1,2-Diphenylhydrazine is unstable even at room temperature and readily converts to azobenzene.
- Phenols are sensitive to active sites and can give a low response or exhibit poor chromatography by tailing. Therefore, it is important the GC is maintained in the best possible condition. See Section 10.1 for proper daily maintenance.
- N-Nitrosodiphenylamine decomposes in the gas chromatographic inlet and cannot be distinguished from diphenylamine.
- 3-Methylphenol cannot be separated from 4-methylphenol by the conditions specified in this method. They are reported as 3 and 4-methylphenol.
- Pyridine may perform poorly at the GC injection port temperatures listed in this SOP. Lowering the injection port temperature may reduce the amount of degradation.

5.0 Safety

Employees must abide by the policies and procedures in the Corporate Environmental Health and Safety Manual (CW-E-M-001) and this document. This procedure may involve hazardous material, operations and equipment. This SOP does not purport to address all of the safety problems associated with its use. It is the responsibility of the user of the method to follow appropriate safety, waste disposal and health practices under the assumption that all samples and reagents are potentially hazardous. Safety glasses, gloves, lab coats and closed-toe, nonabsorbent shoes are a minimum.

5.1. Specific Safety Concerns or Requirements

The gas chromatograph and mass spectrometer contain zones that have elevated temperatures. The analyst needs to be aware of the locations of those zones, and must cool them to room temperature prior to working on them.

The mass spectrometer is under deep vacuum. The mass spectrometer must be brought to atmospheric pressure prior to working on the source.

There are areas of high voltage in both the gas chromatograph and the mass spectrometer. Depending on the type of work involved, either turn the power to the instrument off, or disconnect it from its source of power.

5.2. Primary Materials Used

The following is a list of the materials used in this method, which have a serious or significant hazard rating. **Note: This list does not include all materials used in the method. The table contains a summary of the primary hazards listed in the MSDS for each of the materials listed in the table.** A complete list of materials used in the method can be found in the reagents and materials section. Employees must review the information in the MSDS for each material before using it for the first time or when there are major changes to the MSDS.

Material (1)	Hazards	Exposure Limit (2)	Signs and symptoms of exposure
Methanol	Flammable Poison Irritant	200 ppm-TWA	A slight irritant to the mucous membranes. Toxic effects exerted upon nervous system, particularly the optic nerve. Symptoms of overexposure may include headache, drowsiness and dizziness. Methyl alcohol is a defatting agent and may cause skin to become dry and cracked. Skin absorption can occur; symptoms may parallel inhalation exposure. Irritant to the eyes.
Methylene Chloride	Carcinogen Irritant	25 ppm-TWA 125 ppm-STEL	Causes irritation to respiratory tract. Has a strong narcotic effect with symptoms of mental confusion, light-headedness, fatigue, nausea, vomiting and headache. Causes irritation, redness and pain to the skin and eyes. Prolonged contact can cause burns. Liquid degreases the skin. May be absorbed through skin.
Toluene	Flammable Poison Irritant	200 ppm-TWA 300 ppm-Ceiling	Inhalation may cause irritation of the upper respiratory tract. Symptoms of overexposure may include fatigue, confusion, headache, dizziness and drowsiness. Peculiar skin sensations (e. g. pins and needles) or numbness may be produced. Causes severe eye and skin irritation with redness and pain. May be absorbed through the skin.
Dimethyl-dichloro-silane	Flammable	none	Can be corrosive to the respiratory tract causing severe irritation and tissue damage. Harmful if absorbed through the skin. May cause severe irritation and systemic damage. Severely irritating to the skin and eyes. Harmful if swallowed. Can cause abdominal discomfort, nausea, vomiting, diarrhea, and irritation to the mouth, throat and stomach.
1 – Always add acid to water to prevent violent reactions.			
2 – Exposure limit refers to the OSHA regulatory exposure limit.			

6.0 Equipment and Supplies

6.1 Gas chromatograph/mass spectrometer system

6.1.1 Gas chromatograph: An Agilent/HP 6890/7890/900 Intuvo (or equivalent) houses the capillary column. The GC provides a splitless injection port and allows the column to be directly coupled to the mass spectrometer. The oven is temperature programmable to meet the requirements of the method. An HP/Agilent 7673/7683/7963 autosampler (or equivalent) with a 10 ul syringe provides automatic injection of sample extracts while the instrument is unattended.

6.1.2 Analytical Column: 30m x 0.25mm ID, 0.25 um film thickness, Restek Rxi-5Sil MS, Catalog #13623

6.1.3 Mass spectrometer: Agilent (HP) 5972, 5973, 5975 or 5977A Mass Selective Detector (MSD) Capable of scanning from 35 to 500 amu every 1 sec or less, using 70 volts electron energy in the electron ionization mode. The mass spectrometer must be capable of producing a mass spectrum for 50 ng of decafluorotriphenylphosphine (DFTPP) which meets the criteria in Section 9.2.1 when 2 ul of the 25 ug/ml GC/MS tuning standard is injected through the GC.

6.1.4 GC/MS interface: Any GC-to-MS interface may be used that gives acceptable calibration points at 50 ng per injection for each compound of interest and achieves acceptable tuning performance criteria.

6.1.5 Data system: The data system is interfaced to the mass spectrometer and accommodates continuous acquisition and storage of GC/MS data throughout the duration of the chromatographic program. The data system consists of a Hewlett-Packard Chemstation equipped with Mustang software used for instrument control and data acquisition. This, in turn, is interfaced to TestAmerica's Chrom software for data processing. Data from sample extract analysis can be accessed in real-time, while sample data reports and library searches can be performed on data files from previously run samples. The software is also capable of searching any GC/MS data file for ions of a specific mass whose abundances can be plotted versus time or scan number which allows integration of abundances for any extracted ion between specified times or scan-number limits. Library searches utilize a NIST 02.1 Mass Spectral Library.

6.2 Bottles, glass with polytetrafluoroethylene (PTFE)-lined screw caps or crimp tops.

6.3 Injection port liners, splitless

6.4 Injection port septa

6.5 Injection port graphite seals

6.6 Pre-silanized glass wool (Supelco 2-0411 or equivalent)

6.7 Syringes, Assorted sizes 10ul - 1000ul; gas-tight

6.8 Bottles, 10 and 5ml amber screw cap with Teflon liner

6.9 Vials, 2ml amber screw cap with Teflon liner

6.10 Wheaton microvials 100ul (or equivalent)

6.11 Volumetric Flasks, Class A with ground glass stoppers (2ml - 100ml)

6.12 Analytical balance, ASP Model SP-180 (or equivalent), capable of accurately weighing to 0.0001 gr.

7.0 Reagents and Standards

The following items are recommended for performing this procedure. Equivalent items should only be used when they result in an improvement in quality, efficiency, productivity, or cost. An item can be considered equivalent if with its use, the analytical and QA/QC requirements in this SOP can be met. Please refer to the MSDS prior to the use of any reagent or standard.

The preparation of standards, surrogates and spiking solutions is documented in the TALS Reagent Module. Formulary reports can be generated upon request.

7.1. Reagents:

7.1.1. Methylene Chloride: J.T.Baker Resi-Analyzed, used for Organic Residue Analysis (P/N 9266-V8 or equivalent).

7.1.2. Methanol: J.T.Baker Purge and Trap Grade (P/N 9077-02 or equivalent).

7.1.3. Sylon-CT: Supelco (P/N 33065-U or equivalent). Sylon-CT is a highly reactive silanizing reagent consisting of 95% Toluene and 5% Dimethyldichlorosilane (DMDCS).

7.1.4. Each lot of solvent is screened for contaminants before being used for analysis as detailed in TestAmerica Corporate Quality SOP No. CA-Q-S-001 (*Solvent & Acid Lot Testing & Approval*) and TestAmerica Edison SOP No. ED-GEN-023 (*Bulk Solvent Testing and Approval*).

7.2. Standards:

7.2.1. **Calibration Standards (Full Scan Analysis)**: Stock analytical standard solutions are purchased mainly from Restek Corporation. Other standards are prepared in the laboratory as needed using neat compounds or prepared solutions purchased from Agilent, SPEX CertiPrep, Chem Service,

Accustandard, Supelco or other suppliers. Standards prep instructions are detailed for the following full scan analyte list options:

- Full Volume Aqueous Prep; and,
- Reduced Volume Aqueous Prep and Soils

Secondary dilutions are either made from purchased stock solutions as listed below or from prepared solutions as listed in the following table:

NOTE: Second sources (from certified separate lots) are used for ICV standards.

Table 3 – Full Scan Stock Standards			
Target Analyte Standard Name	**Conc. (PPM)**	**Vendor**	**Catalog #**
1,2,3,4-TCDD	50	SPEX	SVO-TANJ-12
Agilent Mix (contains compounds listed in Table 4 below)	2000 *	Agilent	Cus 0456
8270 List 1/ Std #1 Megamix	Varied	Restek	571995
8270 List 1/ Std#9	2000	Restek	569730
8270 List 1/ Std#11	2000	Restek	569732
8270 Surrogate Standard	5000*	Restek	567685
8270 Internal Standard	2000	Restek	567684
8270 List 1/ Std#10	2000	Restek	569731
Bisphenol-A	1000	Agilent	Cus-0457

*Agilent Mix, 8270 list1/std#9 and 8270 Surrogate standard are diluted to 100ppm prior to the preparation of the 1.0ppm and 0.5ppm standards.

Table 4	
Agilent Mix Catalog No. Cus-0456	
Analyte	**Concentration (PPM)**
Pentachloronitrobenzene	2000
2 -tert-butyl-4-Methylphenol	2000
2,6-Di-tert-butyl-4-Methylphenol	2000
Coumarin	2000
Phenyl ether	2000
N,N'-Dimethylaniline	2000
N-Methylaniline	2000
Carbamazepine	2000
Benzonitrile	2000
1,3-Dimethylnaphthalene	2000

7.2.1.1. Individual calibration standards for full scan analysis are prepared in one of several ways depending upon the technique (full volume aqueous prep, soils prep, reduced volume prep with LVI) as well as the target analyte list. The following tables detail the preparation of calibration standard solutions for each of these techniques and analyte lists. Prepare by combining the indicated volumes of each stock solution using volumetric flask. Dilute to the volume marker with methylene chloride.

Table 5
Full Volume Aqueous Prep and Soils
Working Standards Preparation

Solution Name	120 PPM	80 PPM	50 PPM	20 PPM	10 PPM	5 PPM	2 PPM	1 PPM	0.5 PPM
8270 List 1/ Std #1 Megamix	3000 ul	2000 ul	2500 ul	500ul	250ul	250ul	100ul	50ul	25ul
8270 List 1/ Std #9	1500 ul	1000 ul	1250 ul	250ul	125ul	125ul	50ul	500ul*	250ul *
8270 List 1/ Std #10	1500 ul	1000 ul	1250 ul	250ul	125ul	125ul	-	-	-
Agilent custom Mix	1500 ul	1000 ul	1250 ul	250ul	125ul	125ul	50ul	500ul*	250ul *
1,2,3,4-TCDD	-	-	500ul	-	-	-	-	-	-
8270 Surrogate Standard	600ul	400ul	500ul	100ul	50ul	50ul	20ul	500ul*	250ul *
8270 Internal Standard	500ul	500ul	1000 ul	500ul	500ul	1000 ul	1000 ul	1000 ul	1000 ul
Bisphenol-A	3000 ul	2000 ul	2500 ul	500ul	250ul	250ul	100ul	-	-
8270 List 1/ Std #11	400ul	300ul	500ul	200ul	125ul	125ul	50ul	25ul	-
Final Volume (ml)	**25**	**25**	**50**	**25**	**25**	**50**	**50**	**50**	**50**

Note: The 1.0ppm and 0.5pmm standards (above) are prepared using the 100ug/ml standard for Agilent custom Mix, 8270 List1/std#9 and 8270 Surrogate Standard.

Table 6
Reduced Volume Extraction/LVI
Working Standards Preparation

Solution Name	24 PPM	16 PPM	10 PPM	4 PPM	2 PPM	1 PPM	0.4 PPM	0.2 PPM	0.1 PPM
120 ppm (see Table 5)	2.0mL								
80 ppm (see Table 5)		2.0 mL							
50 ppm (see Table 5)			2.0 mL						
20 ppm (see Table 5)				2.0 mL					

Table 6 Reduced Volume Extraction/LVI Working Standards Preparation									
Solution Name	**24 PPM**	**16 PPM**	**10 PPM**	**4 PPM**	**2 PPM**	**1 PPM**	**0.4 PPM**	**0.2 PPM**	**0.1 PPM**
10 ppm (see Table 5)					2.0 mL				
5.0 ppm (see Table 5)						2.0 mL			
2.0 ppm (see Table 5)							2.0mL		
1.0 ppm (see Table 5)								2.0 mL	
0.5 ppm (see Table 5)									2.0mL
Final Volume (ml)	**10**	**10**	**10**	**10**	**10**	**10**	**10**	**10**	**10**

7.2.1.2. **Initial Calibration Verification (full scan)**: Second source ICVs for full scan analysis are prepared in one of several ways depending upon the technique (full volume aqueous prep, soils prep, reduced volume prep with LVI) as well as the target analyte list. The following tables detail the preparation of ICVs for each of these techniques and analyte lists. Prepare by combining the indicated volumes of each stock solution using volumetric flask. Dilute to the volume marker with methylene chloride.

Table 7 8270/625 ICV Working Standards Preparation	
Solution Name	**25 PPM**
8270 List 1/ Std #1 Megamix (2nd Lot)	250ul
8270 List 1/ Std #9 (2nd Lot)	125ul
8270 List 1/ Std #10 (2nd Lot)	125ul
Agilent custom Mix (2nd Lot)	125ul
8270 Internal Standard	200ul
8270 List 1/ Std#11	125ul
Bisphenol-A (2nd Lot)	250ul
Final Volume (ml)	**10**

7.2.1.3. **Surrogate Standards (Full Scan Analysis):** A 5000ppm Surrogate Standard is purchased from Restek for use in spiking blanks, samples and associated QC prior to extraction (reference the applicable sample prep SOPs for spiking instructions).

Table 8 Full Scan Surrogate Standards Solution Restek Catalog No. 567685	
Surrogate Standard Compounds	**Concentration (PPM)**
Nitrobenzene-d5	5000
p-Terphenyl-d14	5000
2,4,6-Tribromophenol	5000
Phenol-d5	5000
2-Fluorobiphenyl	5000
2-Fluorophenol	5000

7.2.1.4. **Internal Standards** (**Full Scan Analysis**): The Internal Standards Solution at 2000ppm is purchased from Restek (Catalog # 567684). The Internal Standard solution is stored in 10ml amber screw cap bottles with Teflon liners in the dark at 4°C. The Internal standard solution is used in preparing all analytical standards. Inject 20ul of this solution (2000ppm) per ml of sample extract prior to analysis resulting in a concentration of 40ppm (ug/ml) in the extract.

Table 9 Full Scan Internal Standards Solution Restek Catalog No. 567684	
Internal Standard Compounds	**Concentration (PPM)**
1,4-Dichlorobenzene-d4	2000
Phenanthrene-d10	2000
Naphthalene-d8	2000
Chrysene-d12	2000
Acenaphthene-d10	2000
Perylene-d12	2000

7.2.2. **Calibration Standards (SIM analysis)**: The Edison lab currently analyzes only a select list of compounds by 8270D/8270E SIM (see Sections 1.0 and 2.0). Stock analytical SIM standard solutions are purchased mainly from Accustandard. Working standards are prepared from these solutions as listed in the tables in Section 7.2.2.1:

Table 10 Stock SIM Standards			
Standard Name	**Concentration**	**Vendor**	**Catalog #**
Pentachlorophenol	100ppm	Accustandard	App-9-176
n-Nitrosodimethylamine	100ppm	Accustandard	APP-9-149
Hexachlorobenzene	100ppm*	Accustandard	APP-9-112
PAH Mix	100ppm	Accustandard	M-610
Bis(2-chloroethyl)ether	100ppm*	Accustandard	App-9-027
4,6-Dinitro-2-methylphenol	100ppm	Accustandard	P-3845
1,4-Dioxane	1000ppm**	Accustandard	APP-9-096

*Hexachlorobenzene and Bis(2-chloroethyl)ether are diluted to 10ppm prior to SIM Standards prep

** 1,4-Dioxane is diluted (10x) to 100ppm prior to SIM Standards prep

NOTE: Second sources (from separate lots are used for ICV standards).

7.2.2.1 Individual calibration standards for SIM analysis are prepared in one of two ways depending upon the technique (full volume aqueous prep or reduced volume prep with LVI) as well as the target analyte list. The following tables detail the preparation of calibration standard solutions for each of these techniques and analyte lists. Prepare by combining the indicated volumes of each stock solution using volumetric flask. Dilute to the volume marker with methylene chloride.

Table 11
Full Volume Aqueous Prep – SIM
Working Standards Preparation

	0.025 PPM	**0.05 PPM**	**0.1 PPM**	**0.5 PPM**	**1.0 PPM**	**5.0 PPM**
Pentachlorophenol	10uL	25uL	50uL	50uL	100uL	250uL
n-Nitrosodimethylamine	10uL	25uL	50uL	50uL	100uL	250uL
PAH mix	2.5uL	5uL	100uL	25uL	50uL	100uL
Hexachlorobenzene	10uL	25uL	100uL	500uL	1000uL	2500uL
Bis(2-chloroethyl)ether	10uL	25uL	100uL	500uL	1000uL	250uL*
4,6-dinitro-2-methylphenol	50ul	100ul	200ul	200ul	250ul	500ul
1,4-Dioxane	20ul	50ul	100ul	100ul	200ul	500ul
ISTD	200uL	200uL	200uL	100uL	100uL	100uL
Final Volume (ml)	**10**	**10**	**10**	**5**	**5**	**5**

*For Bis(2-chloroethyl)ether the 5.0 ppm level is prepared using the 100ppm standard.

Table 12
Reduced Volume Extraction/LVI – SIM
Working Standards Preparation

	0.005 PPM	**0.01 PPM**	**0.02 PPM**	**0.10 PPM**	**0.20 PPM**	**1.0 PPM**
0.025 PPM Std (see Table 11)	1.0 mL					
0.05 PPM Std (see Table 11)		1.0 mL				
0.1 PPM Std (see Table 11)			1.0 mL			
0.5 PPM Std (see Table 11)				1.0 mL		
1.0 PPM Std (see Table 11)					1.0 mL	
5.0 PPM Std (see Table 11)						1.0 mL
Final Volume (ml)	**5**	**5**	**5**	**5**	**5**	**5**

7.2.2.2 Initial Calibration Verification (SIM): A 0.1 ppm separate lot SIM ICV is prepared as detailed in Table 13 using the stock standards detailed in Section 7.2.2 (above)

Table 13 0.1ppm SIM ICV preparation	
Pentachlorophenol	25uL
n-Nitrosodimethylamine	25uL
PAH mix	5uL
Hexachlorobenzene	5uL
1,4-Dioxane	5ul
4,6-Dinitro-2-methylphenol	100ul
ISTD	**100uL**
Final Volume	**5 ml**

7.2.2.3 Internal Standard solution (SIM): A 50 ppm Internal Standard solution for SIM analysis is prepared by adding 125ul of the 2000ppm stock ISTD (see Section 7.2.1.4) and bringing to volume with Methylene Chloride in a 5ml volumetric flask.

7.2.2.3.1 For SIM analysis inject 20ul of this solution (50ppm) per ml of sample extract prior to analysis resulting in a concentration of 1ppm (ug/ml) in the extract.

.

7.2.3. Calibration Standards (Isotope Dilution SIM – 1,4-Dioxane): The Edison lab currently analyzes only for 1,4-dioxane by 8270D/8270E isotope dilution SIM (see Sections 1.0 and 2.0). Stock analytical isotope dilution SIM standard solutions are purchased mainly from Accustandard and Restek. Working standards are prepared from these solutions as listed in the tables below.

Table 14 - Stock 1,4-Dioxane Isotope Dilution SIM Standards			
Standard Name	**Concentration**	**Vendor**	**Catalog #**
1,4-Dioxane	1000ppm*	Accustandard	APP-9-096

* 1,4-Dioxane is diluted (10x) to 100ppm prior to SIM Standards prep

Table 15 - Stock Labeled 1,4-Dioxane SIM Surrogate/Internal Standard (added at prep)			
Standard Name	**Concentration**	**Vendor**	**Catalog #**
1,4-Dioxane-d8	2000ppm	Restek	30614

Table 16 - Stock 1,4-Dioxane Isotope Dilution SIM Internal Standard (added to extract)			
Standard Name	**Concentration**	**Vendor**	**Catalog #**
1,4-Dichlorobenzene-d4	2000ppm	Accustandard	AZ-014J-3

7.2.3.1 Individual calibration standards for 1,4-dioxane isotope dilution SIM analysis are prepared at the concentrations detailed in the following tables. Prepare by combining the appropriate volumes of each stock solution using volumetric flask. Dilute to the volume marker with methylene chloride.

Table 17
Reduced Volume Extraction/LVI – 1,4-Dioxane Isotope Dilution SIM
ICAL Standard Concentrations (ug/ml)

	Lev 1	Lev 2	Lev 3	Lev 4	Lev 5	Lev 6	Lev 7	Lev 8	ICV*
1,4-Dioxane	0.02	0.04	0.1	0.2	0.5	1	2	10	0.2
1,4-Dioxane-d8	4	4	4	4	4	4	4	4	4
1,4-Dichlorobenzene-d4	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2

***:** The ICV is prepared from the second source stock in Table 13.

7.2.4. GC/MS Instrument Performance Check (DFTPP): The DFTPP standard is prepared by is prepared at 25 ppm by adding 2.5ml of EPA 8270 GC/MS Tuning Solution II (Restek Catalog # 31615) to a 100ml volumetric flask and bringing to volume with Methylene Chloride.

7.2.5. Information on prepared standard solutions must be recorded in the TALS Reagent Module. Information such as standard supplier, lot number, original concentration, a description of how the standard was made, are required along with the laboratory lot number, analyst's initials, date prepared, expiration date and verification signature. Standards must be remade every 6 months, or sooner, if the standards expire or begin to show signs of unacceptable degradation. Class "A" volumetric must be used at all times and syringes, preferably gas-tight syringes when available, should be checked for accuracy using an analytical balance. Class "A" pipettes should also be used if volumes permit.

7.2.6. Please refer to TestAmerica Edison SOP No. ED-GEN-008, Standard Operating Procedure for Preparation, Purity and storage of Reagents and Standards.

- Shelf Life of Standard: 1 year after preparation or stock standard manufacture expiration, whichever comes first;
- Storage Requirements: Stock standards are stored at 4℃ and Working Standards stored at -10℃ to -20℃.

8.0 Sample Collection, Preservation, Shipment and Storage

8.1 All samples must be stored at 4ºC (± 2ºC) upon receipt.

8.2 Sample Extract Storage. Samples extracts must be protected from light and refrigerated at 4ºC (± 2ºC) from time of extraction until analysis.

8.3 Sample Extract Holding Time. All sample extracts must be analyzed within 40 days of extraction.

Matrix	Sample Container	Min. Sample Size	Preservation	Holding Time	Reference
Waters	Amber glass, 1L	1000 ml or 250 ml (1)	Cool 4 ± 2°C	7 days to extraction; Analyze within 40 days of extraction	EPA Method SW846 8270D/8270E
Solids	Wide mouth glass, 8 or 16 oz.	50g	Cool 4 ± 2°C	14 days to extraction; Analyze within 40 days of extraction	EPA Method SW846 8270D/8270E

(1) : Reduced volume extraction (RVE) LVI option

9.0 Quality Control

9.1. **Sample QC** - The following quality control samples are prepared with each batch of samples.

Quality Controls	Frequency	Control Limit
Method Blank (MB)	1 in 20 or fewer samples	< Rpt. Limit
Laboratory Control Sample (LCS)[1]	1 in 20 or fewer samples	Statistical Limits [4]
Matrix Spike (MS)[2]	1 in 20 or fewer samples	Statistical Limits [4]
MS Duplicate (MSD)[2]	1 in 20 or fewer samples	Statistical Limits [4]
Surrogates	every sample[3]	Statistical Limits [4]
Internal Standards	Every sample	Response within -50% to +100% of CCV

[1] LCS Duplicate (LCD) is performed only when insufficient sample is available for the MS/MSD or when requested by the client/project/contract.
[2] The sample selection for MS/MSD are randomly selected, unless specifically requested by a client….predetermined by the extraction lab.
[3] Analytical and QC samples (MB, LCS, MS/MSD, Method Blank)
[4] Statistical control limits are determined annually and are updated into TALS limit group..

9.1.1. **Method blanks** are extracted with every sample batch on each day that samples are extracted. To be considered acceptable, the method blank must contain less than the reporting limit of all target compounds except for phthalates, which can be present at up to 5x the MDL. For method 8270E

the method blank is generally acceptable if target analyte concentrations are less than the one half the reporting limit.

If method blanks are unacceptably contaminated with target compounds that are also present in field samples, all affected samples must be re-extracted and re-analyzed. Corrective action must be taken to identify and eliminate the contamination source. Demonstrate that acceptable blanks can be obtained before continuing with sample extraction and analysis. Method blanks must be analyzed on each instrument on which the associated samples are analyzed.

9.1.1.1. Surrogate recoveries for the method blank are compared to laboratory generated limits. If two or more surrogates for any one fraction (base-neutral or acid) are outside of recovery limits or if any one surrogate recovers at <10%, the sample must be re-extracted and re-analyzed to confirm matrix interference.. If any surrogate is still outside limits, all samples and QC samples associated with that method blank must be re-extracted (volume permitting).

9.1.2. Matrix Spike (MS)/Matrix Spike Duplicate (MSD): A matrix spike/matrix spike duplicate (MS/MSD) pair is extracted and analyzed with every 20 environmental samples of a specific matrix (defined as a sample batch). Full compound list spiking is employed for MS/MSDs and LCSs. These spikes are prepared and extracted concurrent with sample preparation. MS and MSD recoveries are calculated and compared to lab generated acceptance criteria. See the current active TALS 8270 Method Limit Group for QC limits. The MS/MSD spiking solution should the same as used for the calibration standards.

9.1.2.1 A Laboratory Control Sample Duplicate (LCSD) is extracted and analyzed only when insufficient client sample is available for preparation of an MS/MSD pair. The LCS/LSCD is evaluated in the same manner as the MS/MSD (see Section 9.1.2)

9.1.2.2 An LCS/LCSD may be substituted for the MS/MSD if insufficient sample volume is available.

9.1.3. Laboratory Control Sample (LCS)/Laboratory Control Sample Duplicate (LCSD): A Laboratory Control Sample (LCS) (aka blank spike) must be extracted and analyzed with each batch of 20 environmental samples. The LCS data is used to assess method performance if the MS/MSD recoveries fall outside of the lab generated limits (See the current active TALS 8270 Method Limit Group for QC limits). If the LCS recovery is within the current lab generated limits, the MS/MSD recoveries are attributed to matrix interference.

9.1.3.1 A Laboratory Control Sample Duplicate (LCSD) is extracted and analyzed only when insufficient client sample is available for preparation of an MS/MSD pair. The LCS/LSCD is evaluated in the same manner as the MS/MSD (see Section 9.1.2)

9.1.3.2 Spike recovery limits are lab generated and are updated annually. Certain state regulatory programs have defined recovery limits which, where applicable, are used for spike recovery evaluations. The TALS Method Limit Groups detail these regulatory program criteria.

9.1.4. Surrogate Standards: All full scan samples, blanks and QC samples are spiked with a six (6) component surrogate standard mix (see Section 7.2.1.3). The percent recovery of the surrogate standards is calculated and compared to lab generated limits (See the current active TALS 8270 Method Limit Group for QC limits).

If any two or more surrogates for any one fraction (base-neutral or acid) are outside of recovery limits or if any one surrogate recovers at <10%, the sample must be re-extracted and re-analyzed to confirm matrix interference. If a surrogate is diluted to a concentration below that of the lowest calibration standard, no corrective action is necessary.

9.1.4.1 Surrogate recovery limits are lab generated and are updated annually. Certain state regulatory programs have defined recovery limits which, where applicable, are used for spike recovery evaluations. The TALS Method Limit Groups detail these regulatory program criteria.

9.1.5. Internal Standards: The response (area count) of each internal standard in the sample must be within -50 +100% of its corresponding internal standard in the CCV or, the ICAL midpoint for samples analyzed under the initial calibration range. Failure to meet these criteria is indicative of sample matrix effects. All samples failing these criteria must be reanalyzed to confirm matrix effects.

9.2. Instrument QC

9.2.1 GC/MS Instrument Performance Check (DFTPP): (**Note**: the DFTPP performance check applies only to full scan analyses and is not evaluated for SIM analysis). The GC/MS system is tuned using Perfluortributylamine (PFTBA) such that an injection of 50ng of Decafluorotriphenylphosphine (DFTPP) meet the abundance criteria listed in the table below. Prior to the analysis of any calibration standards or samples, the GC/MS system must meet all DFTPP key ion abundance criteria. This analysis will verify proper tuning of the system for a period of 12 hours post-injection. After 12 hours, the instrument performance must again be verified prior to the analysis of standards, QC or samples. Daily tune verification is not required for 8270E CCV.

DFTPP Key Ions and Abundance Criteria	
Mass	**Ion Abundance Criteria**
51	30-60% of mass 198
68	<2% of mass 69
69	reference only
70	<2% of mass 69
127	40-60% of mass 198
197	<1% of mass 198
198	Base Peak, 100% relative abundance
199	5-9% of mass 198
275	10-30% of mass 198
365	>1% of mass 198
441	present but less than mass 443
442	>40% of mass 198
443	17-23% of mass 442

9.2.1.1. Evaluate DFTPP using three scan averaging and background subtraction techniques. Select the scan at the peak apex, add +1 scan from the apex and -1 scans from the apex.

9.2.1.2. The mass spectrum of DFTPP may be background subtracted to eliminate column bleed or instrument background ions. Background subtract DFTPP by selecting a scan for subtraction ≤20 scans before the apex scan of DFTPP.

9.2.1.3. Check column performance using pentachlorophenol and the benzidine peaks (these compounds are included in the DFTPP solution). Benzidine & Pentachlorophenol should respond normally without significant peak tailing (Tailing Factor should be <2 measured at 10% peak height). If responses are poor and excessive peak tailing is present, corrective action for the GC/MS instrument may be required. Corrective actions may include:

9.2.1.3.1 Retune the GC/MS;
9.2.1.3.2 Clip the injector end of the GC column;
9.2.1.3.3 Replace the septum and injection port liner;
9.2.1.3.4 Change the injection port seal;
9.2.1.3.5 Replace the GC column;
9.2.1.3.6 Clean the injection port with MeCl2
9.2.1.3.7 Clean the MS ion source;
9.2.1.3.8 Place a service call.

9.2.1.4. The breakdown of 4, 4-DDT into 4,4-DDD and 4,4'DDE may also be used to assess GC column performance and injection port inertness. If so evaluated the breakdown must be <20%.

9.2.1.5. DFTPP parameter settings are stored in a tune file, which will be used in all subsequent analysis of standards and sample extracts.

9.2.2 Initial Calibration Range and Initial Calibration Verification

9.2.2.1. Initial Calibration: The initial calibration range consists of a minimum of five concentration levels of analytical standards (six for second order regression) prepared as described in Section 7.2. and analyzed once the DFTPP instrument performance check has met the criteria in Section 9.2.1. .

9.2.2.2. Initial Calibration Verification (ICV): An Initial Calibration Verification (ICV) standard is analyzed immediately after the Initial Calibration Range and before any samples are analyzed. The ICV is prepared as detailed in Section 7.2. The ICV must be from a source (or lot) separate from the standards used in the Initial Calibration Range.

9.2.3 Continuing Calibration Verification (CCV) and Low Level Continuing Calibration Verification (LLCCV): A mid-point Continuing Calibration Verification (CCV) must be analyzed every 12 hours after the DFTPP instrument performance check (when applicable).. The CCV is prepared as detailed in Section 7.2. (typically, 50 ug/ml for full volume aqueous and soils, 10 ug/ml for LV, 0.02 ug/ml for LVI SIM) and 0.2 for isotope dilution SIM). Additionally a Low Level Continuing Calibration Verification (LLCCV) is analyzed after the CCV for full scan analysis. The LLCCV is the same as the lowest calibration level analyzed with the initial calibration range (See Section 7.2).

9.2.4 Calibration Acceptance Summary

9.2.4.1. Retention Time Windows: Retention time windows must be established to compensate for minor shifts in absolute retention times as a result of sample loading and normal chromatographic variability. Obtain the retention time for all compounds from the analysis of the midpoint standard for the calibration curve. Establish the center of the retention time window by using the absolute retention time for each analyte, internal standard and surrogate from the calibration verification standard at the beginning of the analytical shift. For samples run during the same shift as an initial calibration, use the retention time of the mid-point standard of the initial calibration. For qualitative identification to be acceptable the retention time of the relative retention time (automatically calculated in Chrom) must be within 0.8 - 1.2 RRT units of its assigned internal standard. The relative retention times of each compound in the five calibration standards must agree within .06 relative retention time units.

9.2.4.2. Initial Calibration Range: Internal standard calibration is employed for this method. After the initial calibration range has been analyzed the relative response factor (RRF) for each target/surrogate compound at each concentration level is determined using the following equation.

$$RRF = \frac{A_x}{A_{is}} \times \frac{C_{is}}{C_x}$$

Where:
A_x = Area characteristic ion (see Table 21) for the compound
Ais = Area characteristic ion (see Table 21) of associated internal standard
Cis = Concentration of internal standard
Cx = Concentration of compound in standard

9.2.4.2.1. Determine the mean RRF for each compound. Minimum response factors must be met for each of the compounds listed in Table 18 (below). Any compound that fails the minimum response factor must be reported as estimated for detects and must have a demonstration of sensitivity in the analytical batch to report non-detects. To demonstrate adequate sensitivity for out of criterion compounds analyze the low level point of the calibration (LLCCV) in the analytical sequence. The criterion for the LLCCV is detection only but the standard qualitative identification criteria in the method must be met.

Table 18:
Minimum Response Factors

Compound	Minimum Response Factor
Benzaldehyde	0.010
Phenol	0.800
Bis(2-chloroethyl) ether	0.700
2-Chlorophenol	0.800
2-Methylphenol	0.700
2,2-Oxybis-(1-chloropropane)	0.010
Acetophenone	0.010
4-Methylphenol	0.600
N-Nitroso-di-n-propylamine	0.500
Hexachloroethane	0.300
Nitrobenzene	0.200
Isophorone	0.400
2-Nitrophenol	0.100
2,4-Dimethylphenol	0.200
Bis(2-chloroethoxy)methane	0.300
2,4-Dichlorophenol	0.200
Naphthalene	0.700

Table 18: Minimum Response Factors	
Compound	**Minimum Response Factor**
4-Chloroaniline	0.010
Hexachlorobutadiene	0.010
Caprolactam	0.010
4-chloro-3-methylphenol	0.200
2-Methylnaphthalene	0.400
Hexachlorocyclopentadiene	0.050
2,4,6-Trichlorophenol	0.200
2,4,5-Trichlorophenol	0.200
1,1'-Biphenyl	0.010
2-Chloronaphthalene	0.800
2-Nitroaniline	0.010
Dimethyl phthalene	0.010
2,6-Dinitrotoluene	0.200
Acenaphthylene	0.900
3-Nitroaniline	0.010
Acenaphthene	0.900
2,4-Dinitrophenol	0.010
4-Nitrophenol	0.010
Dibenzofuran	0.800
2,4-Dinitrotoluene	0.200
Diethyl phthalate	0.010
1,2,4,5-Tetrachlorobenzene	0.010
4-chlorophenyl-phenyl ether	0.400
Fluorene	0.900
4-Nitroanailine	0.010
4,6-Dinitro-2-methylphenol	0.010
4-Bromophenyl-phenyl ether	0.100
N-Nitrosodiphenylamine	0.010
Hexachlorobenzene	0.100
Atrazine	0.010
Pentachlorophenol	0.050
Phenanthrene	0.700
Anthracene	0.700
Carbazole	0.010
Di-n-butyl phthalene	0.010
Fluoranthene	0.600
Pyrene	0.600
Butyl benzyl phthalate	0.010
3,3'-Dichlorobenzidine	0.010
Benzo(a)anthracene	0.800
Chrysene	0.700
Bis-(2-ethylhexyl)phthalate	0.010
Di-n-octyl phthalate	0.010
Benzo(b)fluoranthene	0.700

Table 18: Minimum Response Factors	
Compound	**Minimum Response Factor**
Benzo(k)fluoranthene	0.700
Benzo(a)pyrene	0.700
Indeno(1,2,3-cd)pyrene	0.500
Dibenz(a,h)anthracene	0.400
Benzo(g,h,i)perylene	0.500
2,3,4,6-Tetrachlorophenol	0.010
Pentachloronitrobenzene	0.050

9.2.4.2.2. Calculate the Standard Deviation (SD) and Percent Relative Standard Deviation (% RSD) of the response factors for each compound:

$$\% \text{ RSD} = \frac{\text{Standard Deviation of RRFs}}{\text{Mean RRF}}$$

9.2.4.2.3. The % RSD of the RRF's must be ≤20% for each target analyte listed in Table 18. The % RSD of each target analytes must be ≤20% in order for the calibration range to be acceptable. Additionally for 8270E, the calculated concentration or amount of each analyte of interest in the CCV standard should fall within ±20%. If more than 10% of the compounds included with the initial calibration exceed the 20% RSD limit or do not meet the minimum correlation coefficient (0.99) for alternate fits (see below) then appropriate corrective maintenance action must be performed. If more than 10% of the compounds included with the initial calibration exceed the 20% RSD limit **AND** do not meet the minimum correlation coefficient (0.99) then recalibration is necessary.

9.2.4.2.4. If the above listed criteria is met, the system can be assumed to be linear and sample analysis may begin and the average RF from the initial calibration range is used to quantitate all samples.

9.2.4.2.4.1 Certain state regulatory programs have defined calibration acceptance limits which, where applicable, are used for calibration evaluations. The TALS ICAL Limit Groups detail these regulatory program criteria.

9.2.4.2.5. An alternative calibration technique may be employed for those any compounds exceeding the 20% RSD criteria:

9.2.4.2.5.1 Calculate the first order linear regression for any compound which did not meet the 20% criteria. First order linear regression calibration may be employed if alternative average response calibration procedures were not applicable. The r value (Correlation Coefficient) of the equation must be ≥0.99 for the calibration to be employed.

9.2.4.2.5.2 Second order regression calibration can be used for any compound that has an established history as a non-linear performer.

9.2.4.2.5.3 If second order regression calibration is used a minimum of six (6) calibration levels must be analyzed.

9.2.4.2.5.4 If second order regression calibration is used, the r^2 (Correlation Coefficient) value must be $\geq$ 0.99

9.2.4.2.5.5 Any compound that fails to meet the 20% RSD or or 0.99 correlation coefficient criteria must be flagged as estimated for detects (or must be noted in the narrative). If there are non-detects the compounds may be reported if there is adequate sensitivity to detect at the quantitation limit. To demonstrate adequate sensitivity analyze the low level point of the initial calibration in each analytical batch (LLCCV) The criteria for demonstrating adequate sensitivity is detection in the LLCCV using the standard qualitative identification criteria.

9.2.4.2.5.6. When calculating the calibration curve using the linear calibration model a minimum quantitation check on the viability of the lowest calibration point should be performed by re-fitting the response from the low concentration back into the curve. The recalculated concentration of the low calibration point should be within ±50% of the standard's concentration. This evaluation can be checked using the Initial Calibration %Drift Report in Chrom. Any detects for analytes calibrated using the linear model and failing this readback criterion must be flagged as estimated or detailed in the narrative.

9.2.4.3. Calibration Point Read-back Criteria: Whichever calibration model above is selected, it should be subjected to an additional check to establish the representativeness of the data that were used to produce it. This check is the refitting of each calibration

point response back to the calibration model, or the comparison of the calculated amount of the standard against the expected amount.

- CHROM software provides an Initial Calibration %Drift report which shows the % Error for each calibration point. This report must be reviewed in addition to the %RSD / Linear Response Factor.

- The absolute value of the % Error for each calibration point should be < 30%. For the lowest calibration point, the % Error may be <50%.

- See Section 11.8 for the Calculation of Percent (%) Error.

9.2.4.4. **Initial Calibration Verification (ICV):**.Once the initial calibration has been analyzed and has met the above criteria, a second source Initial Calibration Verification (ICV) (as prepared in Section 7.2) must be analyzed and evaluated. The ICV must meet the criteria of 70-130% recovery for all compounds with the exception of the poor performing compounds listed in Attachment 1 which are allowed to be within 50-150% : An NCM must be initiated to denote any ICV non-conformances.

9.2.4.5. The ICV must meet the criteria of 70-130% recovery for all compounds however up to 10% of the compounds are allowed to exceed these criteria as long as their recoveries are within 65-135%. For the poor performers (see Attachment 1) the range is 50-150%. If the criterion is not met, a second ICV may be analyzed after corrective measures are taken. If a second ICV analysis fails to meet criteria proceed with corrective action and the analysis of a new initial calibration range. Flagging: If the ICV limits are outside of criteria (high) for an analyte and that analyte is undetected in the sample, no flagging or narration is required. If the ICV limits are outside of criteria (low) for an analyte and that analyte is undetected in a sample, narrate the non-conformance in an NCM. When that out of spec analyte is detected in a sample, describe the issue in the narrative, or flag as estimated.

9.2.4.6. **Continuing Calibration Verification (CCV):** A CCV consisting of a standard at or near the midpoint of the Initial Calibration Range is analyzed every 12 hours of instrument operation or at the beginning of an analytical sequence to verify the initial calibration. The calibration verification consists of a DFTPP instrument performance check (not required for 8270E), and analysis of a calibration verification standard. **Note:** Certain state regulatory programs have defined calibration acceptance limits which, where applicable, are used for calibration

evaluations. The TALS ICAL Limit Groups detail these regulatory program criteria.

9.2.4.5.1 Tune Verification: Follow the procedure for verifying the instrument tune described in section 9.2.1 using a 50 ng injection of DFTPP. If the tune cannot be verified, analysis must be stopped, corrective action taken and a return to "control" demonstrated before continuing with the calibration verification process. For 8270E analysis only, tune verification is required just prior to ICAL.

9.2.4.5.2 Calibration Verification: Analyze the calibration verification standard immediately after a DFTPP that meets criteria. Daily analysis of the DFTPP is not required as part of the CCV for 8270E analysis. .When samples are analyzed after an ICAL the last ICAL standard may be used as the starting time reference for evaluation. Use the mid point calibration standard (approximately 50ug/l). NOTE: The calibration standard contains internal standards; Dichlorobenzene d_4, Naphthalene d_8, Acenaphthene d_{10}, Phenanthrene d_{10}, Chrysene d_{12}, and Perylene d_{12} at 40ug/l (0.1ug/L for SIM). The calibration check standard must also include all the target analytes from the original calibration.

9.2.4.5.3 The RFs must meet the criteria for the compounds in Table 18. Any compound that fails the minimum response factor must be reported as estimated for detects and must have a demonstration of sensitivity to report non-detects. To demonstrate adequate sensitivity for out of criterion compounds analyze the low level point of the calibration (LLCCV) in the analytical sequence. The criterion for the LLCCV is detection only but the standard qualitative identification criteria in the method must be met

9.2.4.5.4 The percent difference (when using average response factor) or percent drift (when using linear regression) of the compounds in Table 18 must be ≤20% for at least 80% of the total analyte list. If more than 20% of the compound list fail to 20% difference or drift criterion then appropriate corrective action must be taken prior to the analysis of the samples. Any individual compound that fails must be reported as estimated for detects and must have a demonstration of sensitivity to report non-detects. To demonstrate adequate sensitivity for out of criterion compounds analyze the low level point of the calibration (LLCCV) in the analytical sequence. The

criterion for the LLCCV is detection only (%D criteria are not applied) but the standard qualitative identification criteria in the method must be met.

9.2.4.5.5 **CCV Poor Performers**: Refer to Attachment 1 for the identification of poor and/or erratic performing analytes. These analytes are allowed a %D >20% but must be <50 %D to be acceptable. If there are poor performers that exceed 50%D, the data may be reported provided results are noted as estimated. An NCM must be initiated to denote this situation.

9.2.4.5.6 The retention times of the internal standards from the calibration check must be within ±30 seconds of the internal standards from the mid point standard of the original calibration. If the retention time for any internal standard changes by more than 30 seconds from the latest daily (12 hour) calibration standard, the chromatographic system is inspected for malfunctions, and corrections made as required. If corrective action does not result in the retention time criteria being achieved, the system must be re-calibrated using four additional standards.

9.2.4.5.7 The response (area count) of each internal standard in the calibration verification standard must be within 50 - 100% of its corresponding internal standard in the mid-level calibration standard of the active calibration curve. If the EICP area for any internal standard changes by more than a factor of two (-50% +100%), the mass spectrometer system must be inspected for malfunction and corrections made as appropriate. When corrections are made, re-analysis of samples analyzed while the system was malfunctioning is required.

9.2.4.5.8 The relative retention times of each compound in the calibration verification standard must agree within .06 relative retention time units of its value in the initial calibration.

9.2.4.5.9 Use the average response factors from the original five-point calibration for quantitative analysis of target analytes identified in field samples.

9.2.4.5.10 Prepare a calibration summary or list indicating which compounds did not meet the 20% average percent difference criteria. Record this information in that run log.

9.2.4.7. **Low Level Continuing Calibration Verification (LLCCV):** An LLCCV consisting of the low level standard from the initial

calibration range is analyzed every 12 hours of instrument operation after the CCV. The purpose and evaluation of the LLCCV is described in Section 9.2.4.4.4.

10.0 Procedure

10.1. Gas Chromatograph/Mass Spectrometer Operation

10.1.1. The sequence of events for GC/MS analysis involves many steps. First the injection system and column performance and calibration must be verified. Maintenance operations are performed as needed.

10.1.2. Preparation of the Injection Port Liner and Installation Procedure: Prior to the start of initial calibration and each daily analysis of sample extracts, a new liner for the injection port must be prepared. Once a liner has been used it is no longer inert and will cause serious chromatography problems with phenols and other compounds. When preparing the liner, proper laboratory protection must be worn and the liner must be prepared in a well-ventilated hood. When the procedure is completed all traces of toluene, Sylon-Ct and methanol will be removed immediately so that extraction solvents and preparation of sample extracts will not come into contact with these solvents and become contaminated.

10.1.2.1 Remove one liner from a 40ml VOA bottle containing other liners immersed in Sylon-Ct solution. Rinse off the liner with Toluene and wipe dry. Insert 1cm of pre-silanized glass wool partially into one end of the liner and trim neatly. Push the glass wool into the center of the liner so that it is 1 1/4" from the bottom. Do not use glass wool or solvents that are dirty (i.e. suspended particles) or use liners which are chipped on the ends, deformed or fractured. Inspect the glass wool for cleanliness after it has been inserted.

10.1.2.2 Using a Pasteur pipette flush out the interior of the liner containing the glass wool with Sylon-Ct. Rest the liner horizontally on a small beaker and allow the Sylon-Ct to re-deactivate the interior surfaces and the glass wool. There should be no air bubbles caught in the glass wool. After several minutes flush out the Sylon-Ct with toluene and finally with methanol. Dry the outer surface of the liner and rest it on the injection port housing until the remaining methanol is boiled off

10.1.2.3 Insert the liner with the newly silanized glass wool plug into the injection port. Verify that the column extends up into the injection port and is perpendicular. Inspect the graphite seal and replace it if the edges are knife-shaped.

10.1.2.4 The septum is always replaced daily. Bake out the column at 300^{o}C for 15 minutes after the vacuum in the analyzer has returned to normal.

10.1.2.5 Performance may enhanced by clipping a small portion of the column at the injection port end. Document this activity in the maintenance record.

10.1.3. Prior to calibration or sample analysis always verify that the analyzer is under sufficient vacuum and that the column has proper carrier gas flow.

10.1.4. Establish the following GC/MS operating conditions:

10.1.4.1 Full Scan Operating Mode

Full Scan Mode – Standard Injection Volume
Mass Range: 35 to 500amu
Scan Time: 1 sec/scan
Transfer Line Temperature: 300^{o}C
Source Temperature: Preset by H.P. at 280^{o}C
Scan start time: 1.0 minutes
Initial Column Temperature and Hold Time: 45^{o}C for 0.5 minutes
Column Temperature Program: 20°C /min to 100°C 25°C/min to 270°C 10° C/min to 310°C
Final Column Temperature Hold: 310^{o}C for 5 minutes
Carrier Gas: Ultra High Purity Grade Helium at 1.3ml/min
Injector Temperature: 275^{o}C
Injector: Grob-type, pulse, splitless
Injection Volume: 1ul
Splitless Valve Time: 0.3 minutes

Full Scan Mode – Large Volume Injection (LVI)
Mass Range: 35 to 500amu
Scan Time: 1 sec/scan
Transfer Line Temperature: 300^{o}C
Source Temperature: Preset by H.P. at 280^{o}C
Scan start time: 1.0 minutes
Initial Column Temperature and Hold Time: 45^{o}C for 0.5 minutes
Column Temperature Program: 20°C /min to 100°C

25°C/min to 270°C 10° C/min to 310°C
Final Column Temperature Hold: 310°C for 5 minutes
Carrier Gas: Ultra High Purity Grade Helium at 1.3ml/min
Injector Temperature: 275°C
Injector: Grob-type, pulse, splitless
Injection Volume: 5ul
Splitless Valve Time: 0.3 minutes

10.1.4.2 SIM Operating Mode

SIM Mode
Mass Range: 35 to 500amu
Scan Time: 1 sec/scan
Transfer Line Temperature: 300°C
Source Temperature: Preset by H.P. at 280°C
Scan start time: 1.5 minutes
Initial Column Temperature and Hold Time: 40°C for 0.5 minutes
Column Temperature Program: 20°C /min to 100°C 25°C/min to 270°C 10° C/min to 310°C
Final Column Temperature Hold: 310°C for 3 minutes
Carrier Gas: Ultra High Purity Grade Helium at 1.3ml/min
Injector Temperature: 275°C
Injector: Grob-type, pulse splitless
Injection Volume: 1ul
Splitless Valve Time: 0.3 minutes

10.1.4.3 Isotope Dilution Selected Ion Monitoring Mode :

SIM Parameters

Group 1
Plot 1 Ion: 74.0

Ions/Dwell in Group	(Mass Dwell)	(Mass Dwell)	(Mass Dwell)
	42.0 50	43. 0 50	68.0 50
	74.0 50	128.0 50	129.0 50
	136.0 50	150.0 50	152.0 50
	93.0 50	66.0 50	
	58.0 50		
	88.0 50		

Group 2
Group Start Time: 6.00
Plot 1 Ion: 152.0

Ions/Dwell in Group	(Mass Dwell)	(Mass Dwell)	(Mass Dwell)
	151.0 50	152.0 50	153.0 50
	154.0 50	162.0 50	164.0 50
	165.0 50	166.0 50	

Group 3
Group Start Time: 7.80
Plot 1 Ion: 188.0

Ions/Dwell in Group	(Mass Dwell)	(Mass Dwell)	(Mass Dwell)
	94.0 50	101.0 50	142.0 50
	178.0 50	179.0 50	188.0 50
	202.0 50	264.0 50	266.0 50
	284.0 50		

Group 4
Group Start Time: 10.50
Plot 1 Ion: 228

Ions/Dwell in Group	(Mass Dwell)	(Mass Dwell)	(Mass Dwell)
	120.0 50	228.0 50	229.0 50
	240.0 50		

Group 5
Group Start Time: 12.00
Plot 1 Ion: 252.0

Ions/Dwell in Group	(Mass Dwell)	(Mass Dwell)	(Mass Dwell)
	138.0 50	139.0 50	252.0 50
	253.0 50	260.0 50	264.0 50
	267.0 50	276.0 50	278.0 50

Table 19: Target Compound - Primary and Monitoring Ions

Compound	1	2	3
1,4-Dioxane-d8	96	64	62
1,4-Dioxane	88	58	57
1,4-Dichlorobenzene-d4	152	150	

10.1.5. The above listed instrument conditions are used for all analytical standards for calibration and for all sample extracts analyzed by this method.

10.1.5.1 The column conditions, scan start time, and splitless valve time for analysis of DFTPP only are as follows are as follows:

Initial Column Temperature and Hold Time: 140^{o}C for 0.5 minutes
Column Temperature Program: 140^{o} to 320^{o}C at 22^{o}C/minute
Final Column Temperature Hold: 320C for 0.5 minutes
Scan Start Time: approx. 5 minutes
Splitless Valve Time: 0.3 minutes
Injection Volume: 2 ul

10.2. Analytical Sequence

10.2.1. Dilutions are made based on initial GC/MS analysis. Dilutions are made in 1-ml vials using microsyringes. Calculate the dilution factor using the equation below:

DF= Ph / 5 x Is

Where:

DF = Dilution Factor
Ph = Sample Peak Height
Is = Internal Standard Peak Height

When DF >1 but <2, combine 500ul of sample extract with 500ul methylene chloride in a 1 ml amber vial, add20 ul internal standard and crimp seal

Use **Table 20** to determine dilution and internal standard amount.

Table 20
Dilution Factor Calculations

DF Value	Volume of Sample (ul)	Volume of Methylene Chloride (ul)	Volume of ISTD (ul)
<1	1,000	None	None
>1, <2	500	500	10
>4, <5	200	800	16
>10, <20	100	900	36
>20	500*	500	10

*Prepare this dilution by serially diluting the >10, <20 dilution

10.2.2. Instrument Performance and Calibration Sequence

10.2.2.1. Once the GC/MS instrument has been setup and maintained as detailed in Section 10.1, the first operations to be performed are the performance checks and calibration standards.

10.2.2.2. Analyze the Instrument Performance Check Standard (DFTPP) as discussed in Section 9.2.1.

10.2.2.3. Initially and as required, analyze the Initial Calibration Range (minimum 5 points, six points for second order regression) as detailed in Sections 7.2.1 and 9.2.4.2. Evaluate the acceptability of the Initial Calibration Range as detailed in Section 9.2.4.2.

10.2.2.4. Immediately after the Initial Calibration Range only, analyze the Initial Calibration Verification (ICV) as detailed in Sections 7.2. and 9.2.4.3. Evaluate the acceptability of the ICV as detailed in Section 9.2.4.3.

10.2.2.5. Every 12 hours, reanalyze and evaluate the Instrument Performance Check Standard (DFTPP), not required for 8270E followed by the Continuing Calibration Verification (CCV) and Low Level Continuing Calibration Verification (LLCCV) as detailed in Section 9.2.3, 9.2.4.4 and 9.2.4.5. Evaluate the acceptability of the CCV and LLCCV as detailed in Section 9.2.4.4

10.2.2.6. Client samples and QC samples are analyzed (as detailed in Section 10.2.3) after acceptable Instrument Performance and Calibration Checks and until the 12 hour clock expires. Repeat the sequence as required. The automation of GC/MS runs is accomplished via the “SEQUENCE” macro of the ChemStation.

10.2.3. Sample Analysis Sequence

10.2.3.1. Sample extracts are normally prepared on the same day as analysis. The GC/MS operator will prepare the extracts that will be run on his or her instrument. Volume adjustments to the extracts will be made at the discretion of the supervisor.

10.2.3.2. Prior to the start of sample analysis the GC/MS operator will generate a sequence program containing the list of the sample extracts to be analyzed, the position on the autosampler tray, and the proper acquisition and tune methods that are to be used. This sequence program contains all the necessary information on the samples to be analyzed and how the GC/MS system is to analyze them. The sample extracts are loaded onto the autosampler (ALS) tray. Their position is verified by checking them against the ALS number on the sequence. This batch analysis will be performed automatically over the 12-hour period.

10.2.3.3. The analytical run log is printed as a record of samples analyzed. The analyst will annotate the run log with any required information regarding anomalies or unusual events. The run log must be signed by the analyst and a reviewed and signed by a trained peer or manager

10.3. Data Processing

10.3.1. Prior to processing any standards or samples, target compound lists and sublists must be assembled. Chrom's auto-processing system queries TALS (LIMS) for each sample's processing parameters (including target compounds lists) and downloads the required processing methods from LIMS to analyze data. These lists are required for processing of all data files including calibration files. The data includes compound names, retention time data, quantitation ions, qualitative identification ions, and the assigned internal standard for qualitative and quantitative identification.

10.3.2. Key data is manually entered the first time a compound list is used for data processing. Processing data using a compound list automatically generates response factor data and updates retention information.

10.3.3. The characteristic ions for target compounds, surrogate compounds, and internal standards which can be determined using SW8270D and 8270E are listed in Table 21..

10.4. Interpretation and Qualitative Identification: Qualitative identification of target compounds is based on retention time and mass spectral comparison with characteristic ions in the target compound list. The reference mass spectrum is taken from a standard of the target compound analyzed by this method. The characteristic ions are the three ions of greatest relative intensity or any ions over 30% relative intensity if less than three such ions occur in the reference spectrum. Compounds are identified as present when the following criteria are met:

10.4.1 Target Analytes: Qualitative identification of target compounds is based on retention time and mass spectral comparison with characteristic ions in the target compound list. The reference mass spectrum is taken from a standard of the target compound analyzed by this method. The characteristic ions are the three ions of greatest relative intensity or any ions over 30% relative intensity if less than three such ions occur in the reference spectrum. Compounds are identified as present when the following criteria are met:

10.4.1.1. Once the GC/MS instrument has been setup and maintained as detailed in Section 10.1, the first operations to be performed are the performance checks and calibration standards.

10.4.1.2. The intensities of the characteristic ions of a compound maximize in the same scan or within one scan of each other.

10.4.1.3. The relative retention time (RRT) of the sample component is within ± 0.06 RRT units of the RRT of the standard component.

10.4.1.4. The most abundant ion in the standard target spectrum that equals 100% MUST also be present in the sample target spectrum.

10.4.1.5. All other ions that are greater than 10% in the standard target spectra should also be present in the sample.

10.4.1.6. The relative intensities of the characteristic ions agree within 30% of the relative intensities of these ions in the reference spectrum. (Example: For an ion with an abundance of 50% in the reference spectrum, the corresponding abundance in a sample spectrum can range between 20% and 80%).

10.4.1.7. If the compound does not meet all of the criteria listed above, but is deemed a match in the technical judgment of the mass spectral interpretation specialist, the compound will be positively identified and reported with documentation of the identification noted in the raw data record.

10.4.2 Non-Target Analytes: Upon client request a library search to identify non-target Tentatively Identified Compounds (TIC) is performed. The NIST/EPA/NIH mass spectral library is used to identify non-target compounds (not including internal standard and surrogate compounds) of greatest apparent concentration by a forward search of the library. The following guidelines are used by the analyst when making TIC identifications:

10.4.2.1. Relative intensities of major ions in the reference spectrum (ions greater than 10% of the most abundant ion) should be present in the sample spectrum.

10.4.2.2. The relative intensities of the major ions should agree within ±20%. (Example: For an ion with an abundance of 50% in the standard spectrum, the corresponding sample ion abundance must be between 30 and 70%).

10.4.2.3. Molecular ions present in the reference spectrum should be present in the sample spectrum.

10.4.2.4. Ions present in the sample spectrum but not in the reference spectrum should be reviewed for possible background contamination or presence of co-eluting compounds.

10.4.2.5. Ions present in the reference spectrum but not in the sample spectrum should be reviewed for possible subtraction from the sample spectrum because of background contamination or co-eluting peaks. Data system library reduction programs can sometimes create these discrepancies.

10.4.2.6. If, in the technical judgement of the mass spectral interpretation specialist, no tentative identification can be

made, the compound will be reported as 'Unknown'. If the compound can be further classified the analyst may do so (i.e, 'Unknown hydrocarbon', 'Unknown acid' , etc.).

10.5. Data Reporting

10.5.1. Final Report. The Chom data system automatically produces a data report consisting of hardcopy reports corresponding to specific data reporting requirements, which is uploaded to the TALS LIMS System for the report production group.

10.5.1.1. Total Ion Chromatogram. Full length chromatogram depicting the full length of the GC/MS acquisition.

10.5.1.2. Spectra of all detected target compounds. A page for each detected target compound spectra with a standard reference spectrum for comparison.

10.5.1.3. The calculations of the concentrations of each target compound in the sample, reported in units of ppb, ug/kg or ug/l.

10.5.1.4. Data summaries for each method blank indicating which samples were extracted with the indicated blank.

10.5.1.5. A copy of the initial calibration range together with the calibration verification report, and tune report.

10.5.1.6. Quality Control (QC) data report for each batch including surrogate recoveries, internal standard area summaries, LCS, MS/MSD and RPD summaries.

10.6. The low-level calibration standard establishes the reporting limit. All reported data must be at a concentration at or above the low concentration standard. Any quantitative values below the report limit must be qualified as estimated.

.

11.0. Calculations/Data Reduction

11.1. Target Compounds: are quantitated using the internal standard method (see the formula in Section 11.3).

11.1.1. Identified target compounds are quantitated using the integrated abundance from the EICP of the primary characteristic ion. The internal standard used shall be the one nearest the retention time of the analyte).

11.1.2. The average response factor (RRF) from the initial calibration is used to calculate the target analyte concentration in client samples using the formula found in Section 11.3. See Section 9.2.4 for discussion of RRF.

11.1.3. Secondary ion quantitation is utilized only when there are sample interferences preventing use of the primary characteristic ion. If secondary ion quantitation is used an average relative response factor (RRF) must be calculated using that secondary ion.

11.2. Non-Target Compounds (Tentatively Identified Compounds): An estimated concentration for non-target (tentatively identified compounds) is calculated using the internal standard method (see formula in Section 11.3). For quantiation, the nearest eluting internal standard free of interferences is used. The procedure used for calculating the concentration of non-target compounds is the same as that used for target compounds (see Section 11.1) with the following revisions:

11.2.1. The total area count of the non-target compound is used for As (instead of the area of a characteristic ion).

11.2.2. The total area count of the chosen internal standard is used as Ais (instead of the area of a characteristic ion).

11.2.3. A RF on 1.0 is assumed.

11.2.4. The resulting concentration is qualified as estimated ('J') indicating the quantitative uncertainties of the reported concentration.

11.3. Internal Standard Calculation:

11.3.1. Aqueous Samples

$$\text{Concentration } (\mu g/L) = \frac{(As)(Cis)(D)}{(Ais)(RF)(Vs)\ (Vi)\ (1000)}$$

Where:

As	=	Area of the characteristic ion for the target analyte in the sample
Cis	=	Concentration of the internal standard (ug/L)
D	=	Dilution factor, if the sample or extract was diluted prior to analysis. If no dilution is performed, D = 1.
Vi	=	Volume of the extract injected (ul)
Ais	=	Area of the characteristic for the associated internal standard
RF	=	Average response factor from the initial calibration.
Vs	=	Volume of sample extracted (ml)

The 1000 in the denominator represents the number of ul in 1 ml.

11.3.2. Solid Samples

$$\text{Concentration } (\mu g/KG) = \frac{(As)(Cis)(D)(Vt)}{(Ais)(RF)(Ws)\ (Vi)\ (1000)}$$

Where:

As	=	Area of the characteristic ion for the target analyte in the sample
Cis	=	Concentration of the internal standard (ug/L)
D	=	Dilution factor, if the sample or extract was diluted prior to analysis. If no dilution is performed, D = 1.
Vi	=	Volume of the extract injected (ul)
Ais	=	Area of the characteristic for the associated internal standard
RF	=	Average response factor from the initial calibration.
Vt	=	Volume of concentrated extract (ul)
Ws	=	Weight of sample (g)

The 1000 in the denominator represents the number of ul in 1 ml.

11.4. Relative Response Factors

$$RRF = \frac{A_x}{A_{is}} \times \frac{C_{is}}{C_x}$$

Where:

A_x = Area characteristic ion for the compound (see Table 21)
Ais = Area characteristic ion of associated internal std (See Table 21)
Cis = Concentration of internal standard
Cx = Concentration of compound in standard

11.5. Percent Relative Standard Deviation (% RSD) : as discussed in Section 9.2.4.4 (Initial calibration):

$$\%\ RSD = \frac{\text{Standard Deviation of RRFs}}{\text{Mean RRF}}$$

11.6. Percent Difference (% D):as discussed in Section 9.2.4.4 (Continuing calibration):

$$\%\ D = \frac{RRF_c - \overline{RRF_i}}{\overline{RRF_i}} \times 100$$

Where: RRFc = RRF from continuing calibration

$\overline{RRF_i}$ = Mean RRF from current initial calibration

11.7. Percent Recovery (% R): Surrogates and Spikes

$$\text{Recovery (\%)} = \frac{\text{Concentration (or amount) found}}{\text{Concentration (or amount) added}} \times 100$$

11.8. Calculation of Percent (%) Error

$$\%Error = \frac{x_i - x_i'}{x_i} x\,100$$

Where:

x_i [1] = Measured amount of analyte at calibration level *i*, in mass or concentration units

x_i = True amount

11.9. Dry Weight Correction: All solid samples must be corrected for dry weight using the following formula for dry weight determination.

$$DW = \frac{Gd}{Gw} \times 100$$

Where:

DW	=	Percent % Dry Weight
Gd	=	Dry weight of selected sample aliquot
Gw	=	Wet weight of selected sample aliquot

Multiply the DW value times the wet weight of the sample extracted. NOTE: This calculation can also be performed automatically by the target system provided the DW value is available and entered into the system.

12.0. Method Performance

12.1. Method Detection Limit Study (MDL)

A Method Detection Limit (MDL) study, as described in the TestAmerica corporate Detection and Quantitation Limits SOP, CA-Q-S-006, must be performed initially and whenever a significant change affecting sensitivity is made to the analytical system. The MDL must be re-evaluated from quarterly MDL points at least every 12 months.

12.2. Demonstration of Capabilities

For DOC procedure refer to Section 19 in the most current revision of TestAmerica Edison's Quality Assurance Manual (ED-QA-LQM).

12.3. Lower Limit of Quantitation Verification

The lowest calibration standard analyzed establishes the LLOQ or Reporting Limit. The capability to reliably detect this concentration through the preparation, clean-up and analytical procedure is verified through the annual analysis of a standard at the LLOQ/RL. The LLOQ verification shall also be performed whenever significant changes are made to the preparation and/or analytical procedure.

12.3.1 The LLOQ verification standard shall be prepared at a concentration 0.5-2 times the LLOQ/RL, and be taken through all of the same preparation and clean-up methods as client samples.

12.3.2 The LLOQ verification standard for aqueous matrix shall be prepared using laboratory deionized water and for the solid matrix using clean Ottawa sand. Other clean matrices may be used in addition, for project specific requirements.

12.3.3 The LLOQ shall be verified annually on each instrument used for client sample analysis.

12.3.4 Recovery of each analyte must meet the laboratory established LCS recovery limits + 20%. (For example, if the LCS recovery limits are 70-130%, the LLOQ verification must meet recovery limits of 50-150%.) Once sufficient points have been generated, LLOQ based statistical limits may be used in place of limits based on LCS recovery.

NOTE: The lower recovery limit for the LLOQ can be no lower than 10%.

12.4. Training Requirements

Refer to TestAmerica SOP No. ED-GEN-022, (*Training*), for the laboratory's training program.

13.0. Pollution Control

13.1 It is TestAmerica's policy to evaluate each method and look for opportunities to minimize waste generated (i.e., examine recycling options, ordering chemicals based on quantity needed, preparation of reagents based on anticipated usage and reagent stability). Employees must abide by the policies in Section 13 of the Corporate Environmental Health and Safety Manual (CW-E-M-001) for "Waste Management and Pollution Prevention."

14.0. Waste Management

14.1 Waste management practices are conducted consistent with all applicable rules and regulations. Excess reagents, samples and method process wastes are disposed of in an accepted manner. Waste description rules and land disposal restrictions are followed. Waste disposal procedures are incorporated by reference to TestAmerica Edison SOPs Nos. ED-SPM-007 (*Disposal of Samples and*

Associated Laboratory Waste, current revision) and ED-SPM-008 (*Laboratory Waste Disposal Procedures, current revision).* The following waste streams are produced when this method is carried out:

- Auto sampler vials and expired standards: These vials are collected in satellite accumulation within the instrument laboratory. The vials are then placed into a 55 steel open top drum in the waste room. When the drums are full, the drum will be collected by the waste vendor for disposal. This waste is treated for incineration.

  Teris Profile Number: 50016652
  Onyx Profile WIP Number: 282493

- Mixed Solvent Waste: Mixed solvent waste is collected in a small beaker inside the bench top hood. This waste is then transferred into the satellite accumulation container in the Organic Prep. Lab. on a daily basis. This material is transferred into 5 gallon solvent cans as satellite accumulation. These cans are emptied every 24 hours into a steel drum in the waste room. This drum is kept in the walk in hood until it is full. The full drum is then removed from the hood and placed on secondary containment in the waste room.

  Teris Profile Number: 50016624
  Onyx Profile WIP Number: 545240

14.1. Pollution Prevention

14.2.1. Pollution prevention encompasses any technique that reduces or eliminates the quantity or toxicity of waste at the point of generation. Numerous opportunities for pollution prevention exist in laboratory operation. The USEPA has established a prevention hierarchy of environmental management techniques that places pollution prevention as the management option of first choice. Whenever feasible, laboratory personnel should use pollution prevention techniques to address their waste generation. When wastes cannot be feasibly reduced at the source, the agency recommends recycling as the next best option.

14.2.2. The quantity of chemical purchased should be based on expected usage during its shelf life and disposal cost of unused material. Actual reagent preparation volumes should reflect anticipated usage and reagent stability.

15.0. References / Cross-References

15.1. United States Environmental Protection Agency, “Method SW8270D, Semivolatile Organic Compounds by Gas Chromatography/Mass Spectrometry”, Test Methods for Evaluating Solid Wastes, SW846 Third Edition, Laboratory Manual, Physical/Chemical Methods, Revision 5, July 2014..

15.2. United States Environmental Protection Agency, "Method SW8270E, Semivolatile Organic Compounds by Gas Chromatography/Mass Spectrometry", Test Methods for Evaluating Solid Wastes, SW846 Update IV, Laboratory Manual, Physical/Chemical Methods, Revision 6, June 2018.

15.3. United States Environmental Protection Agency, "Method SW8000D: Determinative Chromatographic Separations", Test Methods for Evaluating Solid Wastes, SW846, Laboratory Manual, Physical/Chemical Methods, Update V, Revision 4, October 2012..

15.4. TestAmerica Edison Document No. ED-QA-LQM, *Laboratory Quality Manual*, current revision.

15.5. TestAmerica Edison SOP No. ED-ORP-002, *SW846 Method 3510C-Extraction of Semi-Volatile Organic Compounds in Water by Separatory Funnel,* current revision.

15.6. TestAmerica Edison SOP No. ED-ORP-043, *SW846 Method 3580A - Waste Dilution Prep for Analysis of BNAs by SW846 Method 8270,* current revision.

15.7. TestAmerica Edison SOP No. ED-ORP-044, *Procedure for the Microwave Extraction of Solids, SW3546, current revision.*

15.8. TestAmerica Document No. CW-E-M-001, Corporate Environmental Health and *Safety Manual,* current revision.

15.9. TestAmerica Corporate Quality SOP No. CA-Q-S-001, *Solvent & Acid Lot Testing & Approval*, current revision.

15.10. TestAmerica Edison SOP No. ED-GEN-023 (*Bulk Solvent Testing and Approval*), current revision.

15.11. TestAmerica Edison SOP No. ED-GCS-001, *Preparation and Screening of Semivolatile Organic Extracts for GC/MS Analysis*, current revision.

15.12. TestAmerica Edison Work Instruction Document No. EDS-WI-012, *Client Complaint/Corrective Action Form,* current revision.

15.13. TestAmerica Edison SOP No. ED-GEN-003, *Standard Operating Procedure for Control of Non-Conformances and Corrective Action,* current revision.

15.14. TestAmerica Edison SOP No. ED-ORP-001, *Extraction of Semivolatile Organic Compounds in Water, EPA Method 625.1,* current revision.

15.15. TestAmerica Edison SOP No. ED-GEN-022, *Training,* current revision.

15.16. TestAmerica Corporate Quality Memorandum, CA-Q-QM-002, *GC/MS Tuning Policy*, current revision.

15.17. TestAmerica Corporate Quality SOP No. CA-Q-S-006, *Detection and Quantitation Limits,* current revision.

16.0. Method Modifications:

Method 8270E requires the DFTPP tune standard to be analyzed once prior to an ICAL and not daily prior to sample analysis. Until such time as 8270D is removed from lab capabilities and in order to satisfy both 8270D and 8270E The laboratory will analyze the DFTPP tune daily, prior to QC and sample analysis. The laboratory will use the tighter criteria from Methods 8270C/8270D for tune evaluation, rather than the criteria suggested in Table 3 of Method 8270E.

17.0. Attachments

Attachment 1 Poor Performing Analytes

18.0. Revision History

- Revision 8, date 06/29/2020
    - Updated to Eurofins branding.
    - Updated throughout to include 8270E requirements.
    - Removed references to SW846 3550B/C prep methods (no longer in use for this method at Edison lab).
    - Update equipment listed in Section 6.0.Updated analytical column in Section 6.1.2.
    - Updated, deleted and renumbered tables as required.
    - Made extensive updates to Standards (sources and preparation) in Section 7.2.
    - Removed all references to Aromatic Amines. Deleted all tables specific to Aromatic Amine analysis. Renumbered remaining tables in document and updated text references.
    - Throughout document clarified tune requirements for 8270E.
    - Following added to Section 9.1.1: For method 8270E the method blank is generally acceptable if target analyte concentrations are less than the one half the reporting limit.
    - Calibration Point Read-back Criteria was added to Section 9.2.4.3. The calculation for percent error was added to Section 11.8.
    - Section 9.2.4.2.3: added following for 8270E: the calculated concentration or amount of each analyte of interest in the CCV standard should fall within ±20%.
    - Section 9.2.4.2.5.6: added ‘The recalculated concentration of the low calibration point should be within ±50% of the standard’s concentration.”
    - Section 12.1 revised to reflect the updated MDL procedure.
    - Added Section 12.3: annual Lower Limit of Quantitation Verification
    - Added Corporate SOP CA-Q-S-006, Detection and Quantitation Limits to references.
    - Section 16.0: added a Method Modification regarding tuning check requirements.
- Revision 7, date 06/08/2018
    - Section 2.3: revised to clarify that RVE/LVI is lab standard procedure.
    - Section 9.1.3: removed statement regarding allowance for up to five analytes to recover outside of lab acceptance limits in LCS/LCSD.
    - Section 9.2.4.3: Replace table ‘ICV Poor Performers (50-150% Recovery) with

expanded list of 'Poor Performing Analytes' in Attachment 1.
  - Added Section 9.2.4.4.5: CCV Poor Performers
  - Corrected number in section 9.2.4.5
  - Added Attachment 1 – Poor Performing Analytes

- Revision 6, date 01/12/2018:

  - Section 7.2.5 included to specify reagent and standard storage conditions.
  - Revised Section 9.1.3 to clarify requirements for specific LCS/LCSD evaluation criteria regarding the # of out of criteria analytes.
  - Revised Section 9.2.4.3 to add 2,4-Dimethylphenol as a poor performing analyte, increased the range for the poor performers to 50-150 and also expanded the guidelines for flagging the ICV outliers.

- Revision 5, dated 09/29/2017:
  - Revised Section 9.1.1 to clarify requirements for surrogate recovery in method blanks.

- Revision 4, dated 08/21/2017:
  - Updated throughout to add a procedure for the analysis of 1,4-dioxane by isotope dilution selected ion monitoring (SIM)
  - Added tables for isotope dilution SIM standards. Renumbered all tables as necessary.
  - Section 7.2.1: added a list of full scan calibration list options.
  - Table 3: Renamed 'Full Scan Stock Standards'.
  - Section 9.2.1: noted that DFTTP applies only to full scan analysis.
  - Section 9.2.3: updated CCV concentrations
  - Added reference to GC/MS Tuning Policy in Section 15.16.

- Revision 3, dated 01/07/2016:
  - Tables 1 and 2: added SIM as option for 1,4-Dioxane.
  - Section 2.3: removed SW3541 (Soxtherm) as option for soils prep (lab has discontinued use of this method). Also removed SW3541 SOP reference from Section 15.0.
  - Tables 19 and 20: added source and prep instructions for 1,4-Dioxane SIM standard. Updated source and prep instructions for 4,6-Dinitro-2-methylphenol.
  - Table 22: added prep instructions for 1,4-Dioxane and 4,6-Dinitro-2-methylphenol SIM ICV standard.
  - Corrected the information in the 'DFTPP Key Ions and Abundance Criteria' table in Section 9.2.1 to match the info found in SW846 8270C.
  - Section 10.1.4.2: updated "SIM Parameters" to included ion masses/dwell times for 1,4-Dioxane.

- Revision 2, dated 01/28/2015:
  - Extensively reformatted the SOP. Placed tables that had been in rear of document into the body of the text. Renumbered tables as applicable and fixed text references to tables.
  - Section 1.1, Table 1: Revised table to include all current analytes. Also footnoted those compounds which are currently analyzed by SIM.

- Section 2.3: added options for extraction of solids by SW846 3456 (Microwave Extraction) and by SW3580A (Waste Dilution) and added SOP references. Deleted reference to SOP ED-ORP-005 (SW3550B – Low Level); Updated Section 15 (References).
- Section 2.5: added text detailing the RVE/LVI options.
- Section 2.6: added table which includes all analytes routinely analyzed by SIM.
- Section 6: updated to include newer GC, MS and autosampler models currently in use.
- Section 6.1.3: added Zebron ZB column as an option.
- Section 7.2: extensively revised standards information to reflect switch to Restek standards.
- Table 3:Added Custom Aromatic Amine Surrogate Standard and revised Table 8 to include initial calibration prep instructions for the Aromatic Amine surrogates.
- Throughout document: removed references to Target and replaced with Chrom.
- Section 7.2.1: Added reference to section 10.2.1.2 for LVI.
- Added Section 7.2.1.3.1 and Table 17A both of which discuss use of Aromatic Amine surrogates.
- Section 7.2.1.2: Added reference to Tables 9,10 and 11 (ICV Preparation)
- Section 8.0: Added Sample container and minimum sample size (250 ml) for Reduced volume extraction.
- Sections 9.1.2, 9.1.3, 9.1.4 and 9.2.4: added statement that certain state regulatory programs have defined recovery limits which, where applicable, are used for spike and calibration evaluations.
- Section 9.1.2: Deleted sentence “A minimum of 16 spiked analytes are reported to in client reports (the full list is reported at least once during each 2 year period because we employ full spiking list.
- Section 9.1.4: Added note regarding use of Aromatic Amine Surrogates.
- Section 9.2.2.2: Added reference to ICV Preparation tables in Section 7.2.
- Section 9.2.3: added more specific info as to the concentration of the CCVs for all techniques.
- Section 9.2.4.2.1: Changed to reflect that each analyte should meet minimum RF’s, not the average across the calibration. Added LLCCV requirement.
- Section 10.3.1: added explanation of Chrom’s interaction with TALS. Removed references to Target.
- Section 9.2.4.2.5.5: Added: (or can be noted in the narrative)
- Section 9.2.4.2.5.6: Revised last sentence to read: “This evaluation can be checked using the Initial Calibration %Drift Report in Chrom.”
- Section 9.2.4.3: Removed 65-135% criteria and added “poor performing” analyte list and associated criteria of 60-140%.
- Section 9.2.4.4.3: Added LLCCV criterion for RFs
- Section 9.2.4.4.4: Added LLCCV criterion for %D
- Section 10.1.4: Updated GC/MS operating conditions for full scan, SIM and DFTPP.
- Section 10.1.4.1: added a table detailing operating conditions for LVI option.
- Table 2: Added 2-ethylaniline, 2,4-dimethylaniline, 3,4-dimethylaniline, 2,3-dimethylaniline, 2,4,5-trimethylaniline and 4-chloro-o-toluidine to Working Standards preparation information.
- Table 25: updated to include all current analytis/surrogates/internal standards and associated ions.
- Throughout document: updated LQM section references as appropriate as some have changed with the latest LQM revision.

- Revision 1, dated 11/07/2011

    - Section 1.1, Table 1: Added Pentachloronitrobenzene and associated CAS# to the analyte list.
    - Section 7.2.1: Added Pentachloronitrobenzene standard information.
    - Table 2: Added Pentachloronitrobenzene to Working Standards preparation information.
    - Table 4: Added Pentachloronitrobenzene and associated minimum RF.
    - Table 8: Added Pentachloronitrobenzene and associated ions.

- Revision 0, dated 02/22/2011: NEW

Table 21
Characteristic Ions Of Semi-Volatile Organic Compounds

Compound	Primary Ion	Secondary Ion(s)
1,1'-Biphenyl	154	153,76
1,2,4,5-Tetrachlorobenzene	216	214, 179
1,2,4-Trichlorobenzene	180	182, 145
1,2-Dichlorobenzene	146	148, 111
1,2-Diphenylhydrazine	77	105, 182
1,3-Dichlorobenzene	146	148, 111
1,3-Dimethylnaphthalene	156	141, 115
1,4-Dichlorobenzene	146	148, 111
1,4-Dichlorobenzene d4 **(ISTD)**	152	150, 115
1,4-Dioxane	88	58, 43
1-Methylnaphthalene	142	141, 115
1-Naphthylamine	143	115, 116
2,2'-oxybis[1-chloropropane]	45	77, 121
2,3,4,6-Tetrachlorophenol	232	131, 230
2,3,7,8-TCDD (screen)	320	322, 324
2,3-Dihydroindene		
2,3-Dimethylaniline	106	129
2,4,5-Trichlorophenol	196	198, 200
2,4,5-Trimethylaniline	102	55, 56
2,4,6-Tribromophenol **(Surrogate)**	330	132, 141
2,4,6-Trichlorophenol	196	198, 200
2,4-Dichlorophenol	162	164, 98
2,4-Xylidine	121	120, 106
2,4-Dimethylphenol	122	107, 121
2,4-Dinitrophenol	184	63, 154
2,4-Dinitrotoluene	165	63, 89
2,6-Dinitrotoluene	165	63, 89
2-Chloronaphthalene	162	127, 164
2-Chlorophenol	128	64, 130

Table 21 Characteristic Ions Of Semi-Volatile Organic Compounds		
Compound	**Primary Ion**	**Secondary Ion(s)**
2-Ethylaniline	106	122,104
2-Fluorobiphenyl **(Surrogate)**	172	171
2-Fluorophenol **(Surrogate)**	112	64
2-Methylnaphthalene	142	141
2-Methylphenol	108	107
2-Naphthylamine	143	115, 116
2-Nitroaniline	65	108, 138
2-Nitrophenol	139	109, 65
2-tert-butyl-4-Methylphenol	149	121, 91
2-Toluidine	107	106, 77
3,3'-Dichlorobenzidine	252	254, 126
3,4-Dimethylaniline	106	129, 127
3,5-Di-tert-butyl-4-Hydroxytol	205	220, 145
3-Nitroaniline	138	108, 65
4,6-Dinitro-2-methylphenol	198	51, 105
4-Bromophenyl phenyl ether	248	250, 141
4-chloro-2-methylaniline	106	144, 142
4-Chloro-3-methylphenol	107	144, 142
4-Chloroaniline	127	129
4-Chloroaniline-d4 **(Surrogate)**	131	133
4-Chlorophenyl phenyl ether	204	206, 141
4-Methylphenol	108	107
4-Nitroaniline	138	108, 65
4-Nitrophenol	139	109, 65
Acenaphthene	154	153, 152
Acenaphthene d10 **(ISTD)**	164	162, 160
Acenaphthylene	152	151, 153
Acetophenone	105	77, 51
Aniline	93	66
Aniline-d5 **(Surrogate**)	98	71,42
Anthracene	178	176, 179
Atrazine	200	173,215
Benzaldehyde	77	105,106
Benzidine	184	92, 185
Benzo(a)anthracene	228	229, 226
Benzo(a)pyrene	252	253, 125
Benzo(b)fluoranthene	252	253, 125
Benzo(g,h,i)perylene	276	138, 277
Benzo(k)fluoranthene	252	253, 125
Benzoic Acid	122	105, 77
Benzyl Alcohol	108	79, 77
Bis(2-chloroethoxy)methane	93	95, 123
Bis(2-chloroethyl)ether	93	63, 95
Bis(2-ethylhexyl)phthalate	149	167, 279
Bisphenol-A	213	228, 119
Butyl benzyl phthalate	149	91, 206

Table 21 Characteristic Ions Of Semi-Volatile Organic Compounds		
Compound	**Primary Ion**	**Secondary Ion(s)**
Caprolactam	113	55,56
Carbamazepine	193	236, 135
Carbazole	167	166, 139
Chrysene	228	226, 229
Chrysene d12 **(ISTD)**	240	120, 136
Coumarin	146	118, 63
Dibenz(a,h)anthracene	278	139, 279
Dibenzofuran	168	139
Diethylphthalate	149	177, 150
Dimethylphthalate	163	194, 164
Di-n-butylphthalate	149	150, 104
Di-n-octylphthalate	149	167, 43
Fluoranthene	202	101, 203
Fluorene	166	165, 167
Hexachlorobenzene	284	142, 249
Hexachlorobutadiene	225	223, 227
Hexachlorocyclopentadiene	237	235, 272
Hexachloroethane	117	201, 199
Indeno(1,2,3-cd)pyrene	276	138, 227
Isophorone	82	95,138
Kepone	272	237, 355
N,N-Dimethylaniline	120	122, 104
Naphthalene	128	129, 127
Naphthalene d8 **(ISTD)**	136	68
n-decane	43	57
Nitrobenzene	77	123, 65
Nitrobenzene-d5 **(Surrogate)**	82	128, 54
N-Nitrosodimethylamine	42	74, 44
N-Nitroso-di-n-propylamine	170	42,101,130
N-Nitrosodiphenylamine	169	168, 167
n-Octadecane	57	43, 85
o-Toluidine-d9 **(Surrogate)**	114	112, 42
Pentachloronitrobenzene	237	214,295
Pentachlorophenol	266	264, 268
Perylene d12 **(ISTD)**	264	260, 265
Phenanthrene	178	179, 176
Phenanthrene d10 **(ISTD)**	188	94, 80
Phenol	94	65, 66
Phenol-d5 **(Surrogate)**	99	42, 71
Phenyl ether	170	77, 115
Pyrene	202	200, 203
Pyridine	79	52, 51
Terphenyl-d14 **(Surrogate)**	244	122, 212

Attachment 1
Poor Performing Compounds

1,2,4,5-Tetrachlorobenzene
1,4-Dioxane
1-Naphthylamine
2,3,4,6-Tetrachlorophenol
2,4-Dimethylphenol
2,4-Dinitrophenol
2-Chloroaniline
2-Naphthylamine
3&4-Methylphenol
3'3-Dichlorobenzidine
4,6-Dinitro-2-methyl- phenol
4-Chloroaniline
4-Nitrophenol
Aniline
Atrazine
Benzaldehyde
Benzidine
Benzoic Acid
Benzyl Alcohol
Biphenyl
Caprolactam
Diphenylamine
Hexachlorocyclopentadiene
Hexachloroethane
n-Decane
n-Nitrosodimethylamine
o,o,o-Triethylphosphorothioate
o-Toluidine
Pentachloronitrobenzene
Pentachlorophenol
Phenol
Pyridine

These analytes are exempt from the ICV and CCV criteria as detailed in this SOP

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES POTABLE WATER
All approved analytes are listed below:

Fuel Additives	
Methyl tert-butyl ether	EPA 524.2
Naphthalene	EPA 524.2
Metals I	
Arsenic, Total	EPA 200.8 Rev. 5.4
Barium, Total	EPA 200.7 Rev. 4.4
	EPA 200.8 Rev. 5.4
Cadmium, Total	EPA 200.7 Rev. 4.4
	EPA 200.8 Rev. 5.4
Chromium, Total	EPA 200.7 Rev. 4.4
	EPA 200.8 Rev. 5.4
Copper, Total	EPA 200.7 Rev. 4.4
	EPA 200.8 Rev. 5.4
Iron, Total	EPA 200.7 Rev. 4.4
Lead, Total	EPA 200.8 Rev. 5.4
Manganese, Total	EPA 200.7 Rev. 4.4
	EPA 200.8 Rev. 5.4
Mercury, Total	EPA 245.1 Rev. 3.0
Selenium, Total	EPA 200.8 Rev. 5.4
Silver, Total	EPA 200.7 Rev. 4.4
	EPA 200.8 Rev. 5.4
Zinc, Total	EPA 200.7 Rev. 4.4
	EPA 200.8 Rev. 5.4
Metals II	
Aluminum, Total	EPA 200.7 Rev. 4.4
	EPA 200.8 Rev. 5.4
Metals II	
Antimony, Total	EPA 200.8 Rev. 5.4
Beryllium, Total	EPA 200.7 Rev. 4.4
	EPA 200.8 Rev. 5.4
Nickel, Total	EPA 200.7 Rev. 4.4
	EPA 200.8 Rev. 5.4
Thallium, Total	EPA 200.8 Rev. 5.4
Vanadium, Total	EPA 200.7 Rev. 4.4
	EPA 200.8 Rev. 5.4
Metals III	
Boron, Total	EPA 200.7 Rev. 4.4
Calcium, Total	EPA 200.7 Rev. 4.4
Magnesium, Total	EPA 200.7 Rev. 4.4
Potassium, Total	EPA 200.7 Rev. 4.4
Sodium, Total	EPA 200.7 Rev. 4.4
Miscellaneous	
Methyl Iodide	EPA 524.2
Organic Carbon, Dissolved	SM 21-23 5310B (-00)
Organic Carbon, Total	SM 21-23 5310B (-00)
Turbidity	SM 21-23 2130 B (-01)
	EPA 180.1 Rev. 2.0
Non-Metals	
Alkalinity	SM 21-23 2320B (-97)
Calcium Hardness	EPA 200.7 Rev. 4.4
Chloride	SM 21-23 4500-Cl- B (-97)

Serial No.: 61389

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES POTABLE WATER
All approved analytes are listed below:

Non-Metals

Chloride	EPA 300.0 Rev. 2.1
Color	SM 21-23 2120B (-01)
Cyanide	LACHAT QuikChem 10-204-00-1-X
	SM 20, 21-23 4500-CN G
	EPA 335.4 Rev. 1.0
Fluoride, Total	EPA 300.0 Rev. 2.1
	SM 21-23 4500-F C (-97)
Nitrate (as N)	EPA 353.2 Rev. 2.0
	EPA 300.0 Rev. 2.1
	SM 21-23 4500-NO3 F (-00)
Nitrite (as N)	EPA 353.2 Rev. 2.0
	EPA 300.0 Rev. 2.1
	SM 21-23 4500-NO3 F (-00)
	SM 21-23 4500-NO2 B (-00)
Orthophosphate (as P)	EPA 300.0 Rev. 2.1
	SM 19, 21-23 4500-P E (-99)
Solids, Total Dissolved	SM 21-23 2540C (-97)
Specific Conductance	SM 21-23 2510B (-97)
Sulfate (as SO4)	ASTM D516-07, 11, 16
	EPA 300.0 Rev. 2.1

Trihalomethanes

Bromodichloromethane	EPA 524.2
Bromoform	EPA 524.2
Chloroform	EPA 524.2
Dibromochloromethane	EPA 524.2

Volatile Aromatics

1,2,3-Trichlorobenzene	EPA 524.2
1,2,4-Trichlorobenzene	EPA 524.2
1,2,4-Trimethylbenzene	EPA 524.2
1,2-Dichlorobenzene	EPA 524.2
1,3,5-Trimethylbenzene	EPA 524.2
1,3-Dichlorobenzene	EPA 524.2
1,4-Dichlorobenzene	EPA 524.2
2-Chlorotoluene	EPA 524.2
4-Chlorotoluene	EPA 524.2
Benzene	EPA 524.2
Bromobenzene	EPA 524.2
Chlorobenzene	EPA 524.2
Ethyl benzene	EPA 524.2
Hexachlorobutadiene	EPA 524.2
Isopropylbenzene	EPA 524.2
n-Butylbenzene	EPA 524.2
n-Propylbenzene	EPA 524.2
p-Isopropyltoluene (P-Cymene)	EPA 524.2
sec-Butylbenzene	EPA 524.2
Styrene	EPA 524.2
tert-Butylbenzene	EPA 524.2
Toluene	EPA 524.2
Total Xylenes	EPA 524.2

Volatile Halocarbons

1,1,1,2-Tetrachloroethane	EPA 524.2

Serial No.: 61389

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES POTABLE WATER
All approved analytes are listed below:

Volatile Halocarbons	
1,1,1-Trichloroethane	EPA 524.2
1,1,2,2-Tetrachloroethane	EPA 524.2
1,1,2-Trichloroethane	EPA 524.2
1,1-Dichloroethane	EPA 524.2
1,1-Dichloroethene	EPA 524.2
1,1-Dichloropropene	EPA 524.2
1,2,3-Trichloropropane	EPA 524.2
1,2-Dichloroethane	EPA 524.2
1,2-Dichloropropane	EPA 524.2
1,3-Dichloropropane	EPA 524.2
2,2-Dichloropropane	EPA 524.2
Bromochloromethane	EPA 524.2
Bromomethane	EPA 524.2
Carbon tetrachloride	EPA 524.2
Chloroethane	EPA 524.2
Chloromethane	EPA 524.2
cis-1,2-Dichloroethene	EPA 524.2
cis-1,3-Dichloropropene	EPA 524.2
Dibromomethane	EPA 524.2
Dichlorodifluoromethane	EPA 524.2
Methylene chloride	EPA 524.2
Tetrachloroethene	EPA 524.2
trans-1,2-Dichloroethene	EPA 524.2
trans-1,3-Dichloropropene	EPA 524.2
Trichloroethene	EPA 524.2
Trichlorofluoromethane	EPA 524.2

Volatile Halocarbons	
Vinyl chloride	EPA 524.2

Serial No.: 61389

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Acrylates	
Acrolein (Propenal)	EPA 8260D
	EPA 624.1
Acrylonitrile	EPA 8260D
	EPA 624.1
Ethyl methacrylate	EPA 8260D
Methyl methacrylate	EPA 8260D
Amines	
1,2-Diphenylhydrazine	EPA 625.1
	EPA 8270E
1-Naphthylamine	EPA 8270E
2,3-Dichloroaniline	EPA 625.1
2-Naphthylamine	EPA 8270E
2-Nitroaniline	EPA 8270E
3-Nitroaniline	EPA 8270E
4-Chloroaniline	EPA 8270E
4-Nitroaniline	EPA 8270E
Aniline	EPA 625.1
	EPA 8270E
Carbazole	EPA 625.1
	EPA 8270E
Diphenylamine	EPA 8270E
Propionitrile	EPA 8260D
Pyridine	EPA 625.1
	EPA 8270E

Benzidines	
3,3'-Dichlorobenzidine	EPA 625.1
	EPA 8270E
Benzidine	EPA 625.1
	EPA 8270E
Chlorinated Hydrocarbon Pesticides	
4,4'-DDD	EPA 8081B
	EPA 608.3
4,4'-DDE	EPA 8081B
	EPA 608.3
4,4'-DDT	EPA 8081B
	EPA 608.3
Aldrin	EPA 8081B
	EPA 608.3
alpha-BHC	EPA 8081B
	EPA 608.3
alpha-Chlordane	EPA 8081B
beta-BHC	EPA 8081B
	EPA 608.3
Chlordane Total	EPA 8081B
	EPA 608.3
delta-BHC	EPA 8081B
	EPA 608.3
Dieldrin	EPA 8081B
	EPA 608.3
Endosulfan I	EPA 8081B

Serial No.: 62193

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Chlorinated Hydrocarbon Pesticides

Endosulfan I	EPA 608.3
Endosulfan II	EPA 8081B
	EPA 608.3
Endosulfan sulfate	EPA 8081B
	EPA 608.3
Endrin	EPA 8081B
	EPA 608.3
Endrin aldehyde	EPA 8081B
	EPA 608.3
Endrin Ketone	EPA 8081B
gamma-Chlordane	EPA 8081B
Heptachlor	EPA 8081B
	EPA 608.3
Heptachlor epoxide	EPA 8081B
	EPA 608.3
Lindane	EPA 8081B
	EPA 608.3
Methoxychlor	EPA 8081B
	EPA 608.3
Mirex	EPA 8081B
Toxaphene	EPA 8081B
	EPA 608.3

Chlorinated Hydrocarbons

1,2,3-Trichlorobenzene	EPA 8260D
1,2,4,5-Tetrachlorobenzene	EPA 8270E

Chlorinated Hydrocarbons

1,2,4-Trichlorobenzene	EPA 625.1
	EPA 8270E
2-Chloronaphthalene	EPA 625.1
	EPA 8270E
Hexachlorobenzene	EPA 625.1
	EPA 8270E
Hexachlorobutadiene	EPA 625.1
	EPA 8270E
Hexachlorocyclopentadiene	EPA 625.1
	EPA 8270E
Hexachloroethane	EPA 625.1
	EPA 8270E

Chlorophenoxy Acid Pesticides

2,4,5-T	EPA 8151A
2,4,5-TP (Silvex)	EPA 8151A
2,4-D	EPA 8151A
2,4-DB	EPA 8151A
Dalapon	EPA 8151A
Dicamba	EPA 8151A
Dichloroprop	EPA 8151A
Dinoseb	EPA 8151A
Pentachlorophenol	EPA 8151A

Demand

Biochemical Oxygen Demand	SM 5210B-2011
Carbonaceous BOD	SM 5210B-2011

Serial No.: 62193

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Demand	
Chemical Oxygen Demand	EPA 410.4, Rev. 2.0 (1993)
	SM 5220D-2011
Fuel Oxygenates	
Di-isopropyl ether	EPA 8260D
Ethanol	EPA 8260D
	EPA 624.1
Methyl tert-butyl ether	EPA 8260D
	EPA 624.1
tert-amyl methyl ether (TAME)	EPA 8260D
tert-butyl alcohol	EPA 8260D
	EPA 624.1
tert-butyl ethyl ether (ETBE)	EPA 8260D
Haloethers	
2,2'-Oxybis(1-chloropropane)	EPA 625.1
	EPA 8270E
4-Bromophenylphenyl ether	EPA 625.1
	EPA 8270E
4-Chlorophenylphenyl ether	EPA 625.1
	EPA 8270E
Bis(2-chloroethoxy)methane	EPA 625.1
	EPA 8270E
Bis(2-chloroethyl)ether	EPA 625.1
	EPA 8270E

Low Level Polynuclear Aromatics	
Acenaphthene Low Level	EPA 8270E SIM
Acenaphthylene Low Level	EPA 8270E SIM
Anthracene Low Level	EPA 8270E SIM
Benzo(a)anthracene Low Level	EPA 8270E SIM
Benzo(a)pyrene Low Level	EPA 8270E SIM
Benzo(b)fluoranthene Low Level	EPA 8270E SIM
Benzo(g,h,i)perylene Low Level	EPA 8270E SIM
Benzo(k)fluoranthene Low Level	EPA 8270E SIM
Chrysene Low Level	EPA 8270E SIM
Dibenzo(a,h)anthracene Low Level	EPA 8270E SIM
Fluoranthene Low Level	EPA 8270E SIM
Fluorene Low Level	EPA 8270E SIM
Indeno(1,2,3-cd)pyrene Low Level	EPA 8270E SIM
Phenanthrene Low Level	EPA 8270E SIM
Pyrene Low Level	EPA 8270E SIM
Metals I	
Barium, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Cadmium, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Calcium, Total	EPA 200.7, Rev. 4.4 (1994)

Serial No.: 62193

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Metals I	
Calcium, Total	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Chromium, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Copper, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Iron, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Lead, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Magnesium, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Manganese, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B

Metals I	
Manganese, Total	EPA 200.8, Rev. 5.4 (1994)
Nickel, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Potassium, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Silver, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Sodium, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Strontium, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
Metals II	
Aluminum, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)

Serial No.: 62193

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Metals II	
Antimony, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Arsenic, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Beryllium, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Chromium VI	USGS I-1230-85
	EPA 7196A
Mercury, Total	EPA 245.1, Rev. 3.0 (1994)
	EPA 7470A
Selenium, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Vanadium, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Zinc, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
Metals II	
Zinc, Total	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Metals III	
Cobalt, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Molybdenum, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Thallium, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Tin, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Titanium, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Mineral	
Acidity	SM 2310B-2011

Serial No.: 62193

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Mineral	
Alkalinity	SM 2320B-2011
Chloride	SM 4500-Cl- B-2011
	EPA 300.0, Rev. 2.1 (1993)
	SM 4110B-2011
	SM 4500-Cl- E-2011
	EPA 9253
Fluoride, Total	EPA 300.0, Rev. 2.1 (1993)
	SM 4110B-2011
Hardness, Total	SM 2340C-2011
	SM 2340B-2011
Sulfate (as SO4)	ASTM D516-11
	EPA 300.0, Rev. 2.1 (1993)
	SM 4110B-2011
Miscellaneous	
Boron, Total	EPA 200.7, Rev. 4.4 (1994)
	EPA 6010D
	EPA 6020B
	EPA 200.8, Rev. 5.4 (1994)
Bromide	EPA 300.0, Rev. 2.1 (1993)
	SM 4110B-2011
Color	SM 2120B-2011
Cyanide, Total	LACHAT QuikChem 10-204-00-1-X
	SM 4500-CN E-2011
	EPA 335.4, Rev. 1.0 (1993)
	EPA 9012B

Miscellaneous	
Oil and Grease Total Recoverable (HEM)	EPA 1664A
Organic Carbon, Total	SM 5310B-2011
	EPA 9060A
Phenols	EPA 420.1 (Rev. 1978)
	EPA 420.4, Rev. 1.0 (1993)
	EPA 9065
	EPA 9066
Specific Conductance	EPA 120.1 (Rev. 1982)
	SM 2510B-2011
	EPA 9050A
Sulfide (as S)	SM 4500-S2- F-2011
	EPA 9034
Turbidity	SM 2130 B-2011
	EPA 180.1, Rev. 2.0 (1993)
Nitroaromatics and Isophorone	
2,4-Dinitrotoluene	EPA 625.1
	EPA 8270E
2,6-Dinitrotoluene	EPA 625.1
	EPA 8270E
Isophorone	EPA 625.1
	EPA 8270E
Nitrobenzene	EPA 625.1
	EPA 8270E
Nitrosoamines	
N-Nitrosodimethylamine	EPA 625.1

Serial No.: 62193

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Nitrosoamines	
N-Nitrosodimethylamine	EPA 8270E
N-Nitrosodi-n-propylamine	EPA 625.1
	EPA 8270E
N-Nitrosodiphenylamine	EPA 625.1
	EPA 8270E
Nutrient	
Ammonia (as N)	SM 4500-NH3 G-2011
	EPA 350.1, Rev. 2.0 (1993)
Nitrate (as N)	EPA 353.2, Rev. 2.0 (1993)
	EPA 300.0, Rev. 2.1 (1993)
	SM 4110B-2011
	SM 4500-NO3 F-2011
Nitrate-Nitrite (as N)	EPA 353.2, Rev. 2.0 (1993)
	EPA 300.0, Rev. 2.1 (1993)
	SM 4110B-2011
	SM 4500-NO3 F-2011
Nitrite (as N)	EPA 353.2, Rev. 2.0 (1993)
	EPA 300.0, Rev. 2.1 (1993)
	SM 4110B-2011
	SM 4500-NO3 F-2011
	SM 4500-NO2 B-2011
Orthophosphate (as P)	SM 4500-P E-2011
Phosphorus, Total	SM 4500-P E-2011
Organophosphate Pesticides	
Atrazine	EPA 8270E
Petroleum Hydrocarbons	
Diesel Range Organics	EPA 8015D
Gasoline Range Organics	EPA 8015D
Phthalate Esters	
Benzyl butyl phthalate	EPA 625.1
	EPA 8270E
Bis(2-ethylhexyl) phthalate	EPA 625.1
	EPA 8270E
Diethyl phthalate	EPA 625.1
	EPA 8270E
Dimethyl phthalate	EPA 625.1
	EPA 8270E
Di-n-butyl phthalate	EPA 625.1
	EPA 8270E
Di-n-octyl phthalate	EPA 625.1
	EPA 8270E
Polychlorinated Biphenyls	
Aroclor 1016 (PCB-1016)	EPA 8082A
	EPA 608.3
Aroclor 1221 (PCB-1221)	EPA 8082A
	EPA 608.3
Aroclor 1232 (PCB-1232)	EPA 8082A
	EPA 608.3
Aroclor 1242 (PCB-1242)	EPA 8082A
	EPA 608.3
Aroclor 1248 (PCB-1248)	EPA 8082A

Serial No.: 62193

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Polychlorinated Biphenyls	
Aroclor 1248 (PCB-1248)	EPA 608.3
Aroclor 1254 (PCB-1254)	EPA 8082A
	EPA 608.3
Aroclor 1260 (PCB-1260)	EPA 8082A
	EPA 608.3
Aroclor 1262 (PCB-1262)	EPA 8082A
Aroclor 1268 (PCB-1268)	EPA 8082A
Polynuclear Aromatics	
Acenaphthene	EPA 625.1
	EPA 8270E
Acenaphthylene	EPA 625.1
	EPA 8270E
Anthracene	EPA 625.1
	EPA 8270E
Benzo(a)anthracene	EPA 625.1
	EPA 8270E
Benzo(a)pyrene	EPA 625.1
	EPA 8270E
Benzo(b)fluoranthene	EPA 625.1
	EPA 8270E
Benzo(g,h,i)perylene	EPA 625.1
	EPA 8270E
Benzo(k)fluoranthene	EPA 625.1
	EPA 8270E
Chrysene	EPA 625.1

Polynuclear Aromatics	
Chrysene	EPA 8270E
Dibenzo(a,h)anthracene	EPA 625.1
	EPA 8270E
Fluoranthene	EPA 625.1
	EPA 8270E
Fluorene	EPA 625.1
	EPA 8270E
Indeno(1,2,3-cd)pyrene	EPA 625.1
	EPA 8270E
Naphthalene	EPA 625.1
	EPA 8270E
Phenanthrene	EPA 625.1
	EPA 8270E
Pyrene	EPA 625.1
	EPA 8270E
Priority Pollutant Phenols	
2,3,4,6 Tetrachlorophenol	EPA 8270E
2,4,5-Trichlorophenol	EPA 625.1
	EPA 8270E
2,4,6-Trichlorophenol	EPA 625.1
	EPA 8270E
2,4-Dichlorophenol	EPA 625.1
	EPA 8270E
2,4-Dimethylphenol	EPA 625.1
	EPA 8270E

Serial No.: 62193

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

Is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Priority Pollutant Phenols

2,4-Dinitrophenol	EPA 625.1
	EPA 8270E
2-Chlorophenol	EPA 625.1
	EPA 8270E
2-Methyl-4,6-dinitrophenol	EPA 625.1
	EPA 8270E
2-Methylphenol	EPA 625.1
	EPA 8270E
2-Nitrophenol	EPA 625.1
	EPA 8270E
3-Methylphenol	EPA 8270E
4-Chloro-3-methylphenol	EPA 625.1
	EPA 8270E
4-Methylphenol	EPA 625.1
	EPA 8270E
4-Nitrophenol	EPA 625.1
	EPA 8270E
Cresols, Total	EPA 8270E
Pentachlorophenol	EPA 625.1
	EPA 8270E
Phenol	EPA 625.1
	EPA 8270E

Residue

Settleable Solids	SM 2540 F-2011
Solids, Total	SM 2540 B-2011

Residue

Solids, Total Dissolved	SM 2540 C-2011
Solids, Total Suspended	SM 2540 D-2011
Solids, Volatile	EPA 160.4 (Issued 1971)

Semi-Volatile Organics

1,1'-Biphenyl	EPA 8270E
1,2-Dichlorobenzene, Semi-volatile	EPA 8270E
1,3-Dichlorobenzene, Semi-volatile	EPA 8270E
1,4-Dichlorobenzene, Semi-volatile	EPA 8270E
2-Methylnaphthalene	EPA 8270E
Acetophenone	EPA 625.1
	EPA 8270E
alpha-Terpineol	EPA 625.1
Benzaldehyde	EPA 8270E
Benzoic Acid	EPA 8270E
Benzyl alcohol	EPA 8270E
Caprolactam	EPA 8270E
Dibenzofuran	EPA 8270E
n-Decane	EPA 625.1
	EPA 8270E
n-Octadecane	EPA 625.1
	EPA 8270E

Volatile Aromatics

1,2,4-Trichlorobenzene, Volatile	EPA 8260D
1,2,4-Trimethylbenzene	EPA 8260D
1,2-Dichlorobenzene	EPA 8260D

Serial No.: 62193

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Volatile Aromatics	
1,2-Dichlorobenzene	EPA 624.1
1,3,5-Trimethylbenzene	EPA 8260D
1,3-Dichlorobenzene	EPA 8260D
	EPA 624.1
1,4-Dichlorobenzene	EPA 8260D
	EPA 624.1
2-Chlorotoluene	EPA 8260D
4-Chlorotoluene	EPA 8260D
Benzene	EPA 8260D
	EPA 624.1
Bromobenzene	EPA 8260D
Chlorobenzene	EPA 8260D
	EPA 624.1
Ethyl benzene	EPA 8260D
	EPA 624.1
Isopropylbenzene	EPA 8260D
m/p-Xylenes	EPA 8260D
	EPA 624.1
Naphthalene, Volatile	EPA 8260D
n-Butylbenzene	EPA 8260D
n-Propylbenzene	EPA 8260D
o-Xylene	EPA 8260D
	EPA 624.1
p-Isopropyltoluene (P-Cymene)	EPA 8260D
sec-Butylbenzene	EPA 8260D
Styrene	EPA 8260D

Volatile Aromatics	
Styrene	EPA 624.1
tert-Butylbenzene	EPA 8260D
Toluene	EPA 8260D
	EPA 624.1
Total Xylenes	EPA 8260D
	EPA 624.1
Volatile Chlorinated Organics	
Benzyl chloride	EPA 8260D
Volatile Halocarbons	
1,1,1,2-Tetrachloroethane	EPA 8260D
1,1,1-Trichloroethane	EPA 8260D
	EPA 624.1
1,1,2,2-Tetrachloroethane	EPA 8260D
	EPA 624.1
1,1,2-Trichloro-1,2,2-Trifluoroethane	EPA 8260D
	EPA 624.1
1,1,2-Trichloroethane	EPA 8260D
	EPA 624.1
1,1-Dichloroethane	EPA 8260D
	EPA 624.1
1,1-Dichloroethene	EPA 8260D
	EPA 624.1
1,1-Dichloropropene	EPA 8260D
1,2,3-Trichloropropane	EPA 8260D
1,2-Dibromo-3-chloropropane	EPA 8260D

Serial No.: 62193

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Volatile Halocarbons	
1,2-Dibromoethane	EPA 8260D
1,2-Dichloroethane	EPA 8260D
	EPA 624.1
1,2-Dichloropropane	EPA 8260D
	EPA 624.1
1,3-Dichloropropane	EPA 8260D
2,2-Dichloropropane	EPA 8260D
2-Chloro-1,3-butadiene (Chloroprene)	EPA 8260D
2-Chloroethylvinyl ether	EPA 8260D
	EPA 624.1
3-Chloropropene (Allyl chloride)	EPA 8260D
Bromochloromethane	EPA 8260D
Bromodichloromethane	EPA 8260D
	EPA 624.1
Bromoform	EPA 8260D
	EPA 624.1
Bromomethane	EPA 8260D
	EPA 624.1
Carbon tetrachloride	EPA 8260D
	EPA 624.1
Chloroethane	EPA 8260D
	EPA 624.1
Chloroform	EPA 8260D
	EPA 624.1
Chloromethane	EPA 8260D
	EPA 624.1

Volatile Halocarbons	
cis-1,2-Dichloroethene	EPA 8260D
	EPA 624.1
cis-1,3-Dichloropropene	EPA 8260D
	EPA 624.1
Dibromochloromethane	EPA 8260D
	EPA 624.1
Dibromomethane	EPA 8260D
Dichlorodifluoromethane	EPA 8260D
	EPA 624.1
Hexachlorobutadiene, Volatile	EPA 8260D
Methyl iodide	EPA 8260D
Methylene chloride	EPA 8260D
	EPA 624.1
Tetrachloroethene	EPA 8260D
	EPA 624.1
trans-1,2-Dichloroethene	EPA 8260D
	EPA 624.1
trans-1,3-Dichloropropene	EPA 8260D
	EPA 624.1
trans-1,4-Dichloro-2-butene	EPA 8260D
Trichloroethene	EPA 8260D
	EPA 624.1
Trichlorofluoromethane	EPA 8260D
	EPA 624.1
Vinyl chloride	EPA 8260D
	EPA 624.1

Serial No.: 62193

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES NON POTABLE WATER
All approved analytes are listed below:

Volatiles Organics	
1,4-Dioxane	EPA 8260D
	EPA 8260D SIM
	EPA 8270D SIM
	EPA 8270E
2-Butanone (Methylethyl ketone)	EPA 8260D
2-Hexanone	EPA 8260D
2-Nitropropane	EPA 8260D
4-Methyl-2-Pentanone	EPA 8260D
Acetone	EPA 8260D
	EPA 624.1
Acetonitrile	EPA 8260D
	EPA 624.1
Carbon Disulfide	EPA 8260D
Cyclohexane	EPA 8260D
Di-ethyl ether	EPA 8260D
Ethyl Acetate	EPA 8260D
Isobutyl alcohol	EPA 8260D
Isopropanol	EPA 8260D
Methyl acetate	EPA 8260D
Methyl cyclohexane	EPA 8260D
n-Butanol	EPA 8260D
o-Toluidine	EPA 8260D
Tetrahydrofuran	EPA 8260D
	EPA 624.1
Vinyl acetate	EPA 8260D
	EPA 624.1

Sample Preparation Methods
SM 4500-P B(5)-2011
EPA 5030C
SM 4500-CN B-2011 and C-201
EPA 9030B
EPA 3010A
EPA 3005A
EPA 3510C
EPA 3520C
SM 4500-NH3 B-2011
EPA 9010C

Serial No.: 62193

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES SOLID AND HAZARDOUS WASTE
All approved analytes are listed below:

Acrylates	
Acrolein (Propenal)	EPA 8260D
Acrylonitrile	EPA 8260D
Ethyl methacrylate	EPA 8260D
Methyl acrylonitrile	EPA 8260D
Methyl methacrylate	EPA 8260D
Amines	
1,2-Diphenylhydrazine	EPA 8270E
1-Naphthylamine	EPA 8270E
2-Naphthylamine	EPA 8270E
2-Nitroaniline	EPA 8270E
3-Nitroaniline	EPA 8270E
4-Chloroaniline	EPA 8270E
4-Nitroaniline	EPA 8270E
Aniline	EPA 8270E
Carbazole	EPA 8270E
Benzidines	
3,3'-Dichlorobenzidine	EPA 8270E
Benzidine	EPA 8270E
Characteristic Testing	
Corrosivity (pH)	EPA 9040C
	EPA 9045D
Free Liquids	EPA 9095B
Ignitability	EPA 1030
	EPA 1020B
Characteristic Testing	
Synthetic Precipitation Leaching Proc.	EPA 1312
TCLP	EPA 1311
Chlorinated Hydrocarbon Pesticides	
4,4'-DDD	EPA 8081B
4,4'-DDE	EPA 8081B
4,4'-DDT	EPA 8081B
Aldrin	EPA 8081B
alpha-BHC	EPA 8081B
alpha-Chlordane	EPA 8081B
Atrazine	EPA 8270E
beta-BHC	EPA 8081B
Chlordane Total	EPA 8081B
delta-BHC	EPA 8081B
Dieldrin	EPA 8081B
Endosulfan I	EPA 8081B
Endosulfan II	EPA 8081B
Endosulfan sulfate	EPA 8081B
Endrin	EPA 8081B
Endrin aldehyde	EPA 8081B
Endrin Ketone	EPA 8081B
gamma-Chlordane	EPA 8081B
Heptachlor	EPA 8081B
Heptachlor epoxide	EPA 8081B
Lindane	EPA 8081B
Methoxychlor	EPA 8081B

Serial No.: 62194

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES SOLID AND HAZARDOUS WASTE
All approved analytes are listed below:

Chlorinated Hydrocarbon Pesticides

Mirex	EPA 8081B
Pentachloronitrobenzene	EPA 8270E
Toxaphene	EPA 8081B

Chlorinated Hydrocarbons

1,2,3-Trichlorobenzene	EPA 8260D
1,2,4-Trichlorobenzene	EPA 8270E
2-Chloronaphthalene	EPA 8270E
Hexachlorobenzene	EPA 8270E
Hexachlorobutadiene	EPA 8270E
Hexachlorocyclopentadiene	EPA 8270E
Hexachloroethane	EPA 8270E

Chlorophenoxy Acid Pesticides

2,4,5-T	EPA 8151A
2,4,5-TP (Silvex)	EPA 8151A
2,4-D	EPA 8151A
2,4-DB	EPA 8151A
Dalapon	EPA 8151A
Dicamba	EPA 8151A
Dichloroprop	EPA 8151A
Dinoseb	EPA 8151A
MCPA	EPA 8151A
MCPP	EPA 8151A
Pentachlorophenol	EPA 8151A

Haloethers

2,2'-Oxybis(1-chloropropane)	EPA 8270E
4-Bromophenylphenyl ether	EPA 8270E
4-Chlorophenylphenyl ether	EPA 8270E
Bis(2-chloroethoxy)methane	EPA 8270E
Bis(2-chloroethyl)ether	EPA 8270E

Low Level Polynuclear Aromatic Hydrocarbons

Acenaphthene Low Level	EPA 8270E SIM
Acenaphthylene Low Level	EPA 8270E SIM
Anthracene Low Level	EPA 8270E SIM
Benzo(a)anthracene Low Level	EPA 8270E SIM
Benzo(a)pyrene Low Level	EPA 8270E SIM
Benzo(b)fluoranthene Low Level	EPA 8270E SIM
Benzo(g,h,i)perylene Low Level	EPA 8270E SIM
Benzo(k)fluoranthene Low Level	EPA 8270E SIM
Chrysene Low Level	EPA 8270E SIM
Dibenzo(a,h)anthracene Low Level	EPA 8270E SIM
Fluoranthene Low Level	EPA 8270E SIM
Fluorene Low Level	EPA 8270E SIM
Indeno(1,2,3-cd)pyrene Low Level	EPA 8270E SIM
Phenanthrene Low Level	EPA 8270E SIM
Pyrene Low Level	EPA 8270E SIM

Metals I

Barium, Total	EPA 6010D EPA 6020B
Cadmium, Total	EPA 6010D

Serial No.: 62194

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES SOLID AND HAZARDOUS WASTE
All approved analytes are listed below:

Metals I

Cadmium, Total	EPA 6020B
Calcium, Total	EPA 6010D
	EPA 6020B
Chromium, Total	EPA 6010D
	EPA 6020B
Copper, Total	EPA 6010D
	EPA 6020B
Iron, Total	EPA 6010D
	EPA 6020B
Lead, Total	EPA 6010D
	EPA 6020B
Magnesium, Total	EPA 6010D
	EPA 6020B
Manganese, Total	EPA 6010D
	EPA 6020B
Nickel, Total	EPA 6010D
	EPA 6020B
Potassium, Total	EPA 6010D
	EPA 6020B
Silver, Total	EPA 6010D
	EPA 6020B
Sodium, Total	EPA 6010D
	EPA 6020B
Strontium, Total	EPA 6010D
	EPA 6020B

Metals II

Aluminum, Total	EPA 6010D
	EPA 6020B
Antimony, Total	EPA 6010D
	EPA 6020B
Arsenic, Total	EPA 6010D
	EPA 6020B
Beryllium, Total	EPA 6010D
	EPA 6020B
Chromium VI	EPA 7196A
Mercury, Total	EPA 7471B
Selenium, Total	EPA 6010D
	EPA 6020B
Vanadium, Total	EPA 6010D
	EPA 6020B
Zinc, Total	EPA 6010D
	EPA 6020B

Metals III

Cobalt, Total	EPA 6010D
	EPA 6020B
Molybdenum, Total	EPA 6010D
	EPA 6020B
Thallium, Total	EPA 6010D
	EPA 6020B
Tin, Total	EPA 6010D
	EPA 6020B

Serial No.: 62194

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES SOLID AND HAZARDOUS WASTE
All approved analytes are listed below:

Metals III	
Titanium, Total	EPA 6010D
	EPA 6020B
Minerals	
Bromide	EPA 9056A
Chloride	EPA 9251
	EPA 9253
	EPA 9056A
Fluoride, Total	EPA 9214
	EPA 9056A
Sulfate (as SO4)	EPA 9038
	EPA 9056A
Miscellaneous	
Boron, Total	EPA 6010D
	EPA 6020B
Cyanide, Total	EPA 9012B
Organic Carbon, Total	Lloyd Kahn Method
Phenols	EPA 9065
Specific Conductance	EPA 9050A
Sulfide (as S)	EPA 9034
Nitroaromatics and Isophorone	
2,4-Dinitrotoluene	EPA 8270E
2,6-Dinitrotoluene	EPA 8270E
Isophorone	EPA 8270E
Nitrobenzene	EPA 8260D
Nitroaromatics and Isophorone	
Pyridine	EPA 8270E
Nitrosoamines	
N-Nitrosodimethylamine	EPA 8270E
N-Nitrosodi-n-propylamine	EPA 8270E
N-Nitrosodiphenylamine	EPA 8270E
Nutrients	
Nitrate (as N)	EPA 9056A
Nitrite (as N)	EPA 9056A
Orthophosphate (as P)	EPA 9056A
Petroleum Hydrocarbons	
Diesel Range Organics	EPA 8015D
Gasoline Range Organics	EPA 8015D
Phthalate Esters	
Benzyl butyl phthalate	EPA 8270E
Bis(2-ethylhexyl) phthalate	EPA 8270E
Diethyl phthalate	EPA 8270E
Dimethyl phthalate	EPA 8270E
Di-n-butyl phthalate	EPA 8270E
Di-n-octyl phthalate	EPA 8270E
Polychlorinated Biphenyls	
Aroclor 1016 (PCB-1016)	EPA 8082A
Aroclor 1016 (PCB-1016) in Oil	EPA 8082A
Aroclor 1221 (PCB-1221)	EPA 8082A

Serial No.: 62194

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES SOLID AND HAZARDOUS WASTE
All approved analytes are listed below:

Polychlorinated Biphenyls

Aroclor 1221 (PCB-1221) in Oil	EPA 8082A
Aroclor 1232 (PCB-1232)	EPA 8082A
Aroclor 1232 (PCB-1232) in Oil	EPA 8082A
Aroclor 1242 (PCB-1242)	EPA 8082A
Aroclor 1242 (PCB-1242) in Oil	EPA 8082A
Aroclor 1248 (PCB-1248)	EPA 8082A
Aroclor 1248 (PCB-1248) in Oil	EPA 8082A
Aroclor 1254 (PCB-1254)	EPA 8082A
Aroclor 1254 (PCB-1254) in Oil	EPA 8082A
Aroclor 1260 (PCB-1260)	EPA 8082A
Aroclor 1260 (PCB-1260) in Oil	EPA 8082A
Aroclor 1262 (PCB-1262)	EPA 8082A
Aroclor 1262 (PCB-1262) in Oil	EPA 8082A
Aroclor 1268 (PCB-1268)	EPA 8082A
Aroclor 1268 (PCB-1268) in Oil	EPA 8082A

Polynuclear Aromatic Hydrocarbons

Acenaphthene	EPA 8270E
Acenaphthylene	EPA 8270E
Anthracene	EPA 8270E
Benzo(a)anthracene	EPA 8270E
Benzo(a)pyrene	EPA 8270E
Benzo(b)fluoranthene	EPA 8270E
Benzo(g,h,i)perylene	EPA 8270E
Benzo(k)fluoranthene	EPA 8270E
Chrysene	EPA 8270E

Polynuclear Aromatic Hydrocarbons

Dibenzo(a,h)anthracene	EPA 8270E
Fluoranthene	EPA 8270E
Fluorene	EPA 8270E
Indeno(1,2,3-cd)pyrene	EPA 8270E
Naphthalene	EPA 8270E
Phenanthrene	EPA 8270E
Pyrene	EPA 8270E

Priority Pollutant Phenols

2,3,4,6 Tetrachlorophenol	EPA 8270E
2,4,5-Trichlorophenol	EPA 8270E
2,4,6-Trichlorophenol	EPA 8270E
2,4-Dichlorophenol	EPA 8270E
2,4-Dimethylphenol	EPA 8270E
2,4-Dinitrophenol	EPA 8270E
2-Chlorophenol	EPA 8270E
2-Methyl-4,6-dinitrophenol	EPA 8270E
2-Methylphenol	EPA 8270E
2-Nitrophenol	EPA 8270E
3-Methylphenol	EPA 8270E
4-Chloro-3-methylphenol	EPA 8270E
4-Methylphenol	EPA 8270E
4-Nitrophenol	EPA 8270E
Pentachlorophenol	EPA 8270E
Phenol	EPA 8270E

Serial No.: 62194

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES SOLID AND HAZARDOUS WASTE
All approved analytes are listed below:

Semi-Volatile Organics	
1,1'-Biphenyl	EPA 8270E
1,2-Dichlorobenzene, Semi-volatile	EPA 8270E
1,3-Dichlorobenzene, Semi-volatile	EPA 8270E
1,4-Dichlorobenzene, Semi-volatile	EPA 8270E
2-Methylnaphthalene	EPA 8270E
Acetophenone	EPA 8270E
Benzaldehyde	EPA 8270E
Benzoic Acid	EPA 8270E
Benzyl alcohol	EPA 8270E
Caprolactam	EPA 8270E
Dibenzofuran	EPA 8270E
Volatile Aromatics	
1,2,4-Trichlorobenzene, Volatile	EPA 8260D
1,2,4-Trimethylbenzene	EPA 8260D
1,2-Dichlorobenzene	EPA 8260D
1,3,5-Trimethylbenzene	EPA 8260D
1,3-Dichlorobenzene	EPA 8260D
1,4-Dichlorobenzene	EPA 8260D
2-Chlorotoluene	EPA 8260D
4-Chlorotoluene	EPA 8260D
Benzene	EPA 8260D
Bromobenzene	EPA 8260D
Chlorobenzene	EPA 8260D
Ethyl benzene	EPA 8260D
Isopropylbenzene	EPA 8260D

Volatile Aromatics	
m/p-Xylenes	EPA 8260D
Naphthalene, Volatile	EPA 8260D
n-Butylbenzene	EPA 8260D
n-Propylbenzene	EPA 8260D
o-Xylene	EPA 8260D
p-Isopropyltoluene (P-Cymene)	EPA 8260D
sec-Butylbenzene	EPA 8260D
Styrene	EPA 8260D
tert-Butylbenzene	EPA 8260D
Toluene	EPA 8260D
Total Xylenes	EPA 8260D
Volatile Chlorinated Organics	
Benzyl chloride	EPA 8260D
Volatile Halocarbons	
1,1,1,2-Tetrachloroethane	EPA 8260D
1,1,1-Trichloroethane	EPA 8260D
1,1,2,2-Tetrachloroethane	EPA 8260D
1,1,2-Trichloro-1,2,2-Trifluoroethane	EPA 8260D
1,1,2-Trichloroethane	EPA 8260D
1,1-Dichloroethane	EPA 8260D
1,1-Dichloroethene	EPA 8260D
1,1-Dichloropropene	EPA 8260D
1,2,3-Trichloropropane	EPA 8260D
1,2-Dibromo-3-chloropropane	EPA 8260D
1,2-Dibromoethane	EPA 8260D

Serial No.: 62194

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES SOLID AND HAZARDOUS WASTE
All approved analytes are listed below:

Volatile Halocarbons	
1,2-Dichloroethane	EPA 8260D
1,2-Dichloropropane	EPA 8260D
1,3-Dichloropropane	EPA 8260D
2,2-Dichloropropane	EPA 8260D
2-Chloro-1,3-butadiene (Chloroprene)	EPA 8260D
2-Chloroethylvinyl ether	EPA 8260D
3-Chloropropene (Allyl chloride)	EPA 8260D
Bromochloromethane	EPA 8260D
Bromodichloromethane	EPA 8260D
Bromoform	EPA 8260D
Bromomethane	EPA 8260D
Carbon tetrachloride	EPA 8260D
Chloroethane	EPA 8260D
Chloroform	EPA 8260D
Chloromethane	EPA 8260D
cis-1,2-Dichloroethene	EPA 8260D
cis-1,3-Dichloropropene	EPA 8260D
Dibromochloromethane	EPA 8260D
Dibromomethane	EPA 8260D
Dichlorodifluoromethane	EPA 8260D
Hexachlorobutadiene, Volatile	EPA 8260D
Methyl iodide	EPA 8260D
Methylene chloride	EPA 8260D
Tetrachloroethene	EPA 8260D
trans-1,2-Dichloroethene	EPA 8260D
trans-1,3-Dichloropropene	EPA 8260D

Volatile Halocarbons	
trans-1,4-Dichloro-2-butene	EPA 8260D
Trichloroethene	EPA 8260D
Trichlorofluoromethane	EPA 8260D
Vinyl chloride	EPA 8260D
Volatile Organics	
1,4-Dioxane	EPA 8260D EPA 8270E
2-Butanone (Methylethyl ketone)	EPA 8260D
2-Hexanone	EPA 8260D
2-Nitropropane	EPA 8260D
4-Methyl-2-Pentanone	EPA 8260D
Acetone	EPA 8260D
Acetonitrile	EPA 8260D
Carbon Disulfide	EPA 8260D
Cyclohexane	EPA 8260D
Di-ethyl ether	EPA 8260D
Ethyl Acetate	EPA 8260D
Isobutyl alcohol	EPA 8260D
Isopropanol	EPA 8260D
Methyl acetate	EPA 8260D
Methyl cyclohexane	EPA 8260D
Methyl tert-butyl ether	EPA 8260D
n-Butanol	EPA 8260D
o-Toluidine	EPA 8270E
Propionitrile	EPA 8260D

Serial No.: 62194

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

NEW YORK STATE DEPARTMENT OF HEALTH
WADSWORTH CENTER

Expires 12:01 AM April 01, 2021
Issued April 01, 2020
Revised October 05, 2020

CERTIFICATE OF APPROVAL FOR LABORATORY SERVICE

Issued in accordance with and pursuant to section 502 Public Health Law of New York State

MS. CATALINA DALANGIN
EUROFINS TESTAMERICA EDISON
777 NEW DURHAM ROAD
EDISON, NJ 08817

NY Lab Id No: 11452

is hereby APPROVED as an Environmental Laboratory in conformance with the National Environmental Laboratory Accreditation Conference Standards (2003) for the category ENVIRONMENTAL ANALYSES SOLID AND HAZARDOUS WASTE
All approved analytes are listed below:

Volatile Organics

Tetrahydrofuran	EPA 8260D
Vinyl acetate	EPA 8260D

Sample Preparation Methods

EPA 5035A-L
EPA 5035A-H
EPA 3580A
EPA 9030B
EPA 3050B
EPA 3550C
EPA 3546
EPA 3060A
EPA 3541
EPA 9010C

Serial No.: 62194

Property of the New York State Department of Health. Certificates are valid only at the address shown, must be conspicuously posted, and are printed on secure paper. Continued accreditation depends on successful ongoing participation in the Program. Consumers are urged to call (518) 485-5570 to verify the laboratory's accreditation status.

ATTACHMENT 4

Roux Standard Operating Procedures

Date: May 5, 2000

1.0 PURPOSE

The purpose for this standard operating procedure (SOP) is to establish the guidelines for decontamination of all field equipment potentially exposed to contamination during drilling, and soil and water sampling. The objective of decontamination is to ensure that all drilling, and soil-sampling and water-sampling equipment is decontaminated (free of potential contaminants): 1) prior to being brought onsite to avoid the introduction of potential contaminants to the site; 2) between drilling and sampling events/activities onsite to eliminate the potential for cross-contamination between boreholes and/or wells; and 3) prior to the removal of equipment from the site to prevent the transportation of potentially contaminated equipment offsite.

In considering decontamination procedures, state and federal regulatory agency requirements must be considered because of potential variability between state and federal requirements and because of variability in the requirements of individual states. Decontamination procedures must be in compliance with state and/or federal protocols in order that regulatory agency(ies) scrutiny of the procedures and data collected do not result in non-acceptance (invalidation) of the work undertaken and data collected.

2.0 PROCEDURE FOR DRILLING EQUIPMENT

The following is a minimum decontamination procedure for drilling equipment. Drilling equipment decontamination procedures, especially any variation from the method itemized below, will be documented on an appropriate field form or in the field notebook.

2.1 The rig and all associated equipment should be properly decontaminated by the contractor before arriving at the test site.

2.2 The augers, drilling casings, rods, samplers, tools, rig, and any piece of equipment that can come in contact (directly or indirectly) with the soil, will be steam cleaned onsite prior to set up for drilling to ensure proper decontamination.

2.3 The same steam cleaning procedures will be followed between boreholes (at a fixed on-site location[s], if appropriate) and before leaving the site at the end of the study.

2.4 All on-site steam cleaning (decontamination) activities will be monitored and documented by a member(s) of the staff of Roux Associates, Inc.

2.5 If drilling activities are conducted in the presence of thick, sticky oils (e.g., PCBs) which coat drilling equipment, then special decontamination procedures may have to be utilized before steam cleaning (e.g., hexane scrub and wash).

2.6 Containment of decontamination fluids may be necessary (e.g., rinseate from steam cleaning) or will be required (e.g., hexane), and disposal must be in accordance with state and/or federal procedures.

3.0 PROCEDURE FOR SOIL-SAMPLING EQUIPMENT

The following is a minimum decontamination procedure for soil-sampling equipment (e.g., split spoons, stainless-steel spatulas). Soil-sampling equipment decontamination procedures, especially any variation from the method itemized below, will be documented on an appropriate field form or in the field notebook.

3.1 Wear disposable gloves while cleaning equipment to avoid cross-contamination and change gloves as needed.

3.2 Steam clean the sampler or rinse with potable water. If soil-sampling activities are conducted in the presence of thick, sticky oils (e.g., PCBs) which coat sampling equipment, then special decontamination procedures may have to be utilized before steam cleaning and washing in detergent solution (e.g., hexane scrub and wash).

3.3 Prepare a non-phosphate, laboratory-grade detergent solution and distilled or potable water in a clean bucket.

3.4 Disassemble the sampler, as necessary and immerse all parts and other sampling equipment in the solution.

3.5 Scrub all equipment in the bucket with a brush to remove any adhering particles.

3.6 Rinse all equipment with copious amounts of potable water followed by distilled or deionized water.

3.7 Place clean equipment on a clean plastic sheet (e.g., polyethylene)

3.8 Reassemble the cleaned sampler, as necessary.

3.9 Transfer the sampler to the driller (or helper) making sure that this individual is also wearing clean gloves or wrap the equipment with a suitable material (e.g., plastic bag, aluminum foil.

As part of the decontamination procedure for soil-sampling equipment, state and/or federal protocols must be considered. These may require procedures above those specified as minimum for Roux Associates, Inc., such as the use of nitric acid, acetone, etc. Furthermore, the containment and proper disposal of decontamination fluids must be considered with respect to regulatory agency(ies) requirements.

4.0 PROCEDURE FOR WATER-SAMPLING EQUIPMENT

The following is a decontamination procedure for water-sampling equipment (e.g., bailers, pumps). Water-sampling equipment decontamination procedures, especially any variation from the method itemized below, will be documented on an appropriate field form or in the field notebook.

4.1 Decontamination procedures for bailers follow:

a. Wear disposable gloves while cleaning bailer to avoid cross-contamination and change gloves as needed.

b. Prepare a non-phosphate, laboratory-grade detergent solution and potable water in a bucket.

c. Disassemble bailer (if applicable) and discard cord in an appropriate manner and scrub each part of the bailer with a brush and solution.

d. Rinse with potable water and reassemble bailer.

e. Rinse with copious amounts of distilled or deionized water.

f. Air dry.

g. Wrap equipment with a suitable material (e.g., clean plastic bag, aluminum foil).

h. Rinse bailer at least three times with distilled or deionized water before use.

4.2 Decontamination procedures for pumps follow:

a. Wear disposable gloves while cleaning pump to avoid cross-contamination and change gloves as needed.

b. Prepare a non-phosphate, laboratory-grade detergent solution and potable water in a clean bucket, clean garbage can, or clean 55-gallon drum.

c. Flush the pump and discharge hose (if not disposable) with the detergent solution and discard disposable tubing and/or cord in an appropriate manner.

d. Flush the pump and discharge hose (if not disposable) with potable water.

e. Place the pump on clear plastic sheeting.

f. Wipe any pump-related equipment (e.g., electrical lines, cables, discharge hose) that entered the well with a clean cloth and detergent solution, and rinse or wipe with a clean cloth and potable water.

g. Air dry.

h. Wrap equipment with a suitable material (e.g., clean plastic bag).

As part of the decontamination procedure for water-sampling equipment, state and/or federal protocols must be considered. These may require procedures above those specified as minimum for Roux Associates, Inc., such as the use of nitric acid, acetone, etc. Furthermore, the containment and proper disposal of decontamination fluids must be considered with respect to regulatory agency(ies) requirements.

Date: May 5, 2000

1.0 PURPOSE

The purpose of this Standard Operating Procedure (SOP) is to establish guidelines for the collection of soil samples for laboratory analysis. This SOP is applicable to soil samples collected from split-spoon samplers during drilling, hand auger samples, grab samples from stockpiled soils, surface samples, test pit samples, etc.

2.0 CONSIDERATIONS

Soil samples may be collected in either a random or biased manner. Random samples can be based on a grid system or statistical methodology. Biased samples can be collected in areas of visible impact or suspected source areas. Soil samples can be collected at the surface, shallow subsurface, or at depth. When samples are collected at depth the water content should be noted, since generally "soil sampling" is restricted to the unsaturated zone. Equipment selection will be determined by the depth of the sample to be collected. A thorough description of the sampling locations and proposed methods of sample collection should be included in the work plan.

Commonly, surface sampling refers to the collection of samples at a 0 to 6-inch depth interval. Certain regulatory agencies may define the depth interval of a surface sample differently, and this must be defined in the work plan. Collection of surface soil samples is most efficiently accomplished with the use of a stainless-steel trowel or scoop. For samples at greater depths a decontaminated bucket auger or power auger may be needed to advance the hole to the point of sample collection. Another clean bucket auger should then be used to collect the sample. To collect samples at depths of greater than approximately six feet the use of a drill rig and split spoon samples will usually be necessary. In some situations, sample locations are accessed with the use of a backhoe.

3.0 MATERIALS/EQUIPMENT

a. A work plan which outlines soil sampling requirements.

b. Field notebook, field form(s), maps, chain-of-custody forms, and custody seals.

c. Decontamination supplies (including: non-phosphate, laboratory grade detergent, buckets, brushes, potable water, distilled water, regulatory-required reagents, aluminum foil, plastic sheeting, etc.).

d. Sampling device (split-spoon sampler, stainless steel hand auger, stainless steel trowel, etc.).

e. Stainless steel spoons or spatulas.

f. Disposable sampling gloves.

g. Laboratory-supplied sample containers with labels.

h. Cooler with blue or wet ice.

i. Plastic sheeting.

j. Black pen and indelible marker.

k. Zip-lock bags and packing material.

l. Tape measure.

m. Paper towels or clean rags.

n. Masking and packing tape.

o. Overnight (express) mail forms.

4.0 DECONTAMINATION

All reusable sampling equipment will be thoroughly cleaned according to the decontamination SOP. Where possible, thoroughly pre-cleaned and wrapped sampling equipment should be used and dedicated to individual sampling locations. Disposable items such as sampling gloves, aluminum foil, and plastic sheeting will be changed after each use and discarded in an appropriate manner.

5.0 PROCEDURE

5.1 Prior to collecting soil samples, ensure that all sampling equipment has been thoroughly cleaned according to the decontamination SOP. If samples are to be collected at depth, then the boring must be advanced with thoroughly cleaned equipment to the desired sampling horizon and a different thoroughly cleaned sampler must be used to collect the sample.

5.2 Using disposable gloves and a pre-cleaned, stainless steel spatula or spoon, extract the soil sample from the sampler, measure the recovery, and separate the wash from the true sample. Where allowed by regulatory agency(ies), disposable plastic spoons may be used.

5.3 Place the sample in a laboratory-supplied, pre-cleaned sample container. This should be done as quickly as possible and this is especially important when sampling for volatile organic compounds (VOCs). Samples to be analyzed for VOCs must be collected prior to other constituents.

5.4 The sample container will be labeled with appropriate information such as, client name, site location, sample identification (location, depth, etc.), date and time of collection, and sampler's initials.

5.5 Using the remaining portion of soil from the sampler, log the sample in detail and record sediment characteristics (color, odor, moisture, texture, density, consistency, organic content, layering, grain size, etc.).

5.6 If soil samples are to be composited in the field, then equal portions from selected locations will be placed on a clean plastic sheet and homogenized. Alternately, several samples may be submitted to the laboratory for compositing by weight. The method used is dependent upon regulatory requirements. Specific compositing procedures shall be approved by the appropriate regulatory agency and described in the work plan. Samples to be analyzed for VOCs will not be composited unless required by a regulatory agency.

5.7 After the sample has been collected, labeled, and logged in detail, it is placed in a zip-lock bag and stored in a cooler at 4°C.

5.8 A chain-of-custody form is completed for all samples collected. One copy is retained and two are sent with the samples in a zip-lock bag to the laboratory. A custody seal is placed on the cooler prior to shipment.

5.9 Samples collected from Monday to Friday are to be delivered to the laboratory within 24 hours of collection. If Saturday delivery is unavailable, samples collected on Friday must be delivered by Monday morning. Check the work plan to determine if any analytes require a shorter delivery time.

5.10 The field notebook and appropriate forms should include, but not be limited to the following: client name, site location, sample location, sample depth, sample identification, date and time collected, sampler's name, method of sample collection, number and type of containers, geologic description of material, description of decontamination procedures, etc. A site map should be prepared with exact measurements to each sample location in case follow-up sampling is necessary.

5.11 All reusable sampling equipment must be thoroughly cleaned in accordance with the decontamination SOP. Following the final decontamination (after all samples are collected) the sampling equipment is wrapped in aluminum foil. Discard any gloves, foil, plastic, etc. in an appropriate manner that is consistent with site conditions.

END OF PROCEDURE

Date: May 5, 2000

1.0 PURPOSE

The purpose of this standard operating procedure (SOP) is to establish guidelines for the sampling of ground-water monitoring wells for dissolved constituents. As part of the SOP for the sampling of ground-water monitoring wells, sample collection equipment and devices must be considered, and equipment decontamination and pre-sampling procedures (e.g., measuring water levels, sounding wells, and purging wells) must be implemented. Sampling objectives must be firmly established in the work plan before considering the above.

Valid water-chemistry data are integral to a hydrogeologic investigation that characterizes ground-water quality conditions. Water-quality data are used to evaluate both current and historic aquifer chemistry conditions, as well as to estimate future conditions (e.g., trends, migration pathways). Water-quality data can be used to construct ground-water quality maps to illustrate chemical conditions within the flow system, to generate water-quality plots to depict conditions with time and trends, and to perform statistical analyses to quantify data variability, trends, and cleanup levels.

2.0 EQUIPMENT AND MATERIALS

2.1 In order to sample ground water from monitoring wells, specific equipment and materials are required. The equipment and materials list may include, but not necessarily be limited to, the following:

a. Bailers (Teflon™ or stainless steel).

b. Pumps (centrifugal, peristaltic, bladder, electric submersible, bilge, hand-operated diaphragm, etc.).

c. Gas-displacement device(s).

d. Air-lift device(s).

e. Teflon™ tape, electrical tape.

f. Appropriate discharge hose.

g. Appropriate discharge tubing (e.g., polypropylene, teflon, etc.) if using a peristaltic pump.

h. Appropriate compressed gas if using bladder-type or gas-displacement device.

i. Portable generator and gasoline or alternate power supply if using an electric submersible pump.

j. Non-absorbent cord (e.g., polypropylene, etc.).

k. Plastic sheeting.

l. Tape measure (stainless steel, steel, fiberglass) with 0.01-foot measurement increments and chalk (blue carpenter's).

m. Electronic water-level indicators (e.g., m-scope, etc.) or electric water-level/product level indicators.

n. Non-phosphate, laboratory-grade detergent.

o. Distilled/Deionized water.

p. Potable water.

q. Paper towels, clean rags.

r. Roux Associates' field forms (e.g., daily log, well inspection checklist, sampling, etc.) and field notebook.

s. Well location and site map.

t. Well keys.

u. Stop watch, digital watch with second increments, or watch with a second hand.

v. Water Well Handbook.

w. Calculator.

x. Black pen and water-proof marker.

y. Tools (e.g., pipe wrenches, screwdrivers, hammer, pliers, flashlight, pen knife, etc.).

z. Appropriate health and safety equipment, as specified in the site health and safety plan (HASP).

aa. pH meter(s) and buffers.

bb. Conductivity meter(s) and standards.

cc. Thermometer(s).

dd. Extra batteries (meters, thermometers, flashlight).

ee. Filtration apparatus, filters, pre-filters.

ff. Plasticware (e.g., premeasured buckets, beakers, flasks, funnels).

gg. Disposable gloves.

hh. Water jugs.

ii. Laboratory-supplied sample containers with labels.

jj. Cooler(s).

kk. Ice (wet, blue packs).

ll. Masking, duct, and packing tape.

mm. Chain-of-custody form(s) and custody seal(s).

nn. Site sampling and analysis plan (SAP).

oo. Site health and safety plan (HASP).

pp. Packing material (e.g., bubble wrap)

qq. "Zip-lock" plastic bags.

rr. Overnight (express) mail forms.

3.0 DECONTAMINATION

3.1 Make sure all equipment is decontaminated and cleaned before use (refer to the SOP for Decontamination of Field Equipment for detailed decontamination methods, summaries for bailers and pumps are provided below). Use new, clean materials when decontamination is not appropriate (e.g., non-absorbent cord, disposable gloves). Document, and initial and date the decontamination procedures on the appropriate field form and in the field notebook.

a. Decontaminate a bailer by: 1) wearing disposable gloves, 2) disassembling (if appropriate) and scrubbing in a non-phosphate, laboratory-grade detergent and distilled/deionized water solution, and 3) rinsing first with potable water and then distilled/deionized water.

b. Decontaminate a pump by: 1) wearing disposable gloves, 2) flushing the pump and discharge hose (if not disposable) first with a non-phosphate, laboratory-grade detergent and potable water solution in an appropriate

container (clean bucket, garbage can, or 55-gallon drum) and then with distilled/deionized water or potable water, and 3) wiping pump-related equipment (e.g., electrical lines, cables, discharge hose) first with a clean cloth and detergent solution and then rinsing or wiping with a clean cloth and distilled/deionized water or potable water.

3.2 Note that the decontamination procedures for bailers and pumps are the minimum that must be performed. Check the work plan to determine if chemicals specified by individual state regulatory agencies must also be used for decontamination procedures (e.g., hexane, nitric acid, acetone, isopropanol, etc.).

4.0 CALIBRATION OF FIELD ANALYSIS EQUIPMENT

Calibrate field analysis equipment before use (e.g., thermometers, pH and conductivity meters, etc.). Refer to the specific SOP for field analysis for each respective piece of equipment. Document, and initial and date the calibration procedures on the appropriate field form, in the field notebook, and in the calibration log book.

5.0 PROCEDURE

5.1 Document, and initial and date well identification, pre-sampling information, and problems encountered on the appropriate field form and in the field notebook as needed.

5.2 Inspect the protective casing of the well and the well casing, and note any items of concern such as a missing lock, or bent or damaged casing(s).

5.3 Place plastic sheeting around the well to protect sampling equipment from potential cross contamination.

5.4 Remove the well cap or plug and, if necessary, clean the top of the well off with a clean rag. Place the cap or plug on the plastic sheeting. If the well is not vented, allow several minutes for the water level in the well to equilibrate. If fumes or gases are present, then diagnose these with the proper safety equipment. Never inhale the vapors.

5.5 Measure the depth to water (DTW) from the measuring point (MP) on the well using a steel tape and chalk or an electronic sounding device (m-scope). Refer to the specific SOPs for details regarding the use of a steel tape or a m-scope for measuring water levels. Calculate the water-level elevation. Document, and initial and date the information on the appropriate field form and in the field notebook.

5.6 Measuring the total depth of the well from the MP with a weighted steel tape. Calculate and record the volume of standing water in the well casing on the appropriate field form and in the field notebook.

5.7 Decontaminate the equipment used to measure the water level and sound the well with a non-phosphate, laboratory-grade detergent solution followed by a distilled/deionized water rinse.

5.8 Purge the well prior to sampling (refer to the SOP for Purging a Well). The well should be pumped or bailed to remove the volume of water specified in the work plan. Usually three to five casing volumes are removed if the recharge rate is adequate to accomplish this within a reasonable amount of time.

If the formation cannot produce enough water to sustain purging, then one of two options must be followed. These include: 1) pumping or bailing the well dry, or 2) pumping or bailing the well to "near-dry" conditions (i.e., leaving some water in the well). The option employed must be specified in the work plan and be in accordance with regulatory requirements.

If the well is purged dry, then all the standing water has been removed and upon recovery the well is ready for sampling. However, depending on the rate of recovery and the time needed to complete the sampling round, one of the following procedures may have to be implemented: 1) the well may have to be sampled over a period of more than one day; 2) the well may not yield enough water to collect a complete suite of samples and only select (most important) samples will be collected; or 3) the well may not recover which will preclude sampling. Regardless of the option that must be followed, the sampling procedure must be fully documented. When preparing to conduct a sampling round, review drilling, development, and previous sampling information (if available) to identify low-yielding wells in order to purge them first, and potentially allow time for the well to recover for sampling.

5.9 Record the physical appearance of the water (i.e. color, turbidity, odor, etc.) on the appropriate field form and in the field notebook, as it is purged. Note any changes that occur during purging.

5.10 If a bailer is used to collect the sample, then:

a. Flush the decontaminated bailer three times with distilled/deionized water.

b. Tie the non-absorbent cord (polypropylene) to the bailer with a secure knot and then tie the free end of the bailer cord to the protective casing or, if possible, some nearby structure to prevent losing the bailer and cord down the well.

c. Lower the bailer slowly down the well and into the water column to minimize disturbance of the water surface. If a bottom-filling bailer is used, then do not submerge the top of the bailer; however, if a top-filling bailer is used, then submerge the bailer several feet below the water surface.

d. Remove and properly discard one bailer volume from the well to rinse the bailer with well water before sampling. Again, lower the bailer slowly down the well to the appropriate depth depending on the bailer type (as discussed above in 5.11 c). When removing the bailer from the well, do not allow the bailer cord to rest on the ground but coil it on the protective plastic sheeting placed around the well. Certain regulatory agencies require that the first bailer volume collected be utilized for the samples.

5.11 If a pump is used to collect the sample, then use the same pump used to purge the well and, if need be, reduce the discharge rate to facilitate filling sample containers and to avoid problems that can occur while filling sample containers (as listed in Number 5.14, below). Alternately, the purge pump may be removed and a thoroughly decontaminated bailer can be used to collect the sample.

5.12 Remove each appropriate container's cap only when ready to fill each with the water sample, and then replace and secure the cap immediately.

5.13 Fill each appropriate, pre-labeled sample container carefully and cautiously to prevent: 1) agitating or creating turbulence; 2) breaking the container; 3) entry of, or contact with, any other medium; and 4) spilling/splashing the sample and exposing the sampling team to contaminated water. Immediately place the filled sample container in an ice-filled (wet ice or blue pack) cooler for storage. If wet ice is used it is recommended that it be repackaged in zip-lock bags to help keep the cooler dry and the sample labels secure. Check the work plan as to whether wet ice or blue packs are specified for cooling the samples because certain regulatory agencies may specify the use of one and not the other.

5.14 "Top-off" containers for volatile organic compounds (VOCs) and tightly seal with Teflon™-lined septums held in place by open-top screw caps to prevent volatilization. Ensure that there are no bubbles by turning the container upside down and tapping it gently.

5.15 Filter water samples (Procedure 4.6) collected for dissolved metals analysis prior to preservation to remove the suspended sediment from the sample. If water samples are to be collected for total metals analysis, then collect a second set of samples without field filtering.

In the event that the regulatory agency(ies) want unfiltered samples for metals analysis, a second set of filtered samples should also be collected. Because unfiltered samples are indications of total metals (dissolved and suspended) they are not representative of aquifer conditions because ground water does not transport sediment (except in some rare cases). Thus, the results for dissolved metals in ground water should be based on filtered samples even if both filtered and unfiltered sets are presented in a report.

5.16 Add any necessary preservative(s) to the appropriate container(s) prior to, or after (preferred), the collection of the sample, unless the appropriate preservative(s) have already been added by the laboratory before shipment.

5.17 Collect quality control (QC) samples as required in the work plan to monitor sampling and laboratory performance. Refer to the SOP for Collection of Quality Control Samples.

5.18 Conduct field analyses after sample collection is complete by measuring and recording the temperature, conductivity, pH, etc. (as called for in the work plan). Note and record the "final" physical appearance of the water (after purging and sampling) on an appropriate field form and in the field notebook.

5.19 Wipe the well cap with a clean rag, replace the well cap and protective cover (if present). Lock the protective cover.

5.20 Verify that each sample is placed in an individual "zip-lock" bag, wrapped with "bubble wrap," placed in the cooler, and that the cooler has sufficient ice (wet ice or blue packs) to preserve the samples for transportation to the analytical laboratory.

5.21 Decontaminate bailers, hoses, and pumps as discussed in the decontamination SOP. Wrap decontaminated equipment with a suitable material (e.g., clean plastic bag or aluminum foil). Discard cords, rags, gloves, etc. in a manner consistent with site conditions.

5.22 Complete all necessary field forms, field notebook entries, and the chain-of-custody forms. Retain one copy of each chain-of-custody form. Secure the cooler with sufficient packing tape and a custody seal.

5.23 Samples collected from Monday through Friday will be delivered within 24 hours of collection. If Saturday delivery is not available, samples collected on Friday must be delivered by Monday morning. Consult the work plan to determine if any of the analytes require a shorter delivery time.

END OF PROCUDURE

Date: May 5, 2000

1.0 PURPOSE

The purpose of this standard operating procedure (SOP) is to establish guidelines for sample handling which will allow consistent and accurate results. Valid chemistry data are integral to investigations that characterize media-quality conditions. Thus, this SOP is designed to ensure that once samples are collected, they are preserved, packed and delivered in a manner which will maintain sample integrity to as great an extent as possible. The procedures outlined are applicable to most sampling events and any required modifications must be clearly described in the work plan.

2.0 CONSIDERATIONS

Sample containers, sampling equipment decontamination, quality assurance/quality control (QA/QC), sample preservation, and sample handling are all components of this SOP.

2.1 Sample Containers

Prior to collection of a sample, considerations must be given to the type of container that will be used to store and transport the sample. The type and number of containers selected is usually based on factors such as sample matrix, potential contaminants to be encountered, analytical methods requested, and the laboratory's internal quality assurance requirements. In most cases, the overriding considerations will be the analytical methodology, or the state or federal regulatory requirements because these regulations generally encompass the other factors. The sample container selected is usually based on some combination of the following criteria:

a. Reactivity of Container Material with Sample

Choosing the proper composition of sample containers will help to ensure that the chemical and physical integrity of the sample is maintained. For sampling potentially hazardous material, glass is the recommended container type because it is chemically inert to most substances. Plastic containers are not recommended for most hazardous wastes because the potential exists for contaminants to adsorb to the surface of the plastic or for the plasticizer to leach into the sample.

In some instances, however, the sample characteristics or analytes of interest may dictate that plastic containers be used instead of glass. Because some metals species will adhere to the sides of the glass containers in an aqueous matrix, plastic bottles (e.g., nalgene) must be used for samples collected for metals analysis. A separate, plastic

container should accompany glass containers if metals analysis is to be performed along with other analyses. Likewise, other sample characteristics may dictate that glass cannot be used. For example, in the case of a strong alkali waste or hydrofluoric solution, plastic containers may be more suitable because glass containers may be etched by these compounds and create adsorptive sites on the container's surface.

b. Volume of the Container

The volume of sample to be collected will be dictated by the analysis being performed and the sample matrix. The laboratory must supply bottles of sufficient volume to perform the required analysis. In most cases, the methodology dictates the volume of sample material required to complete the analysis. However, individual laboratories may provide larger volume containers for various analytes to ensure sufficient quantities for duplicates or other QC checks.

To facilitate transfer of the sample from the sampler into the container and to minimize spillage and sample disturbance, wide-mouth containers are recommended. Aqueous volatile organic samples must be placed into 40-milliliter (ml) glass vials with polytetrafluoroethylene (PTFE) (e.g., TeflonTM) septums. Non-aqueous volatile organic samples should be collected in the same type of vials or in 4-ounce (oz) wide-mouth jars provided by the laboratory. These jars should have PTFE-lined screw caps.

c. Color of Container

Whenever possible, amber glass containers should be used to prevent photodegradation of the sample, except when samples are being collected for metals analysis. If amber containers are not available, then containers holding samples should be protected from light (i.e., place in cooler with ice immediately after filling).

d. Container Closures

Container closures must screw on and off the containers and form a leak-proof seal. Container caps must not be removed until the container is ready to be filled with the sample, and the container cap must be replaced (securely) immediately after filling it. Closures should be constructed of a material which is inert with respect to the sampled material, such as PTFE (e.g., TeflonTM). Alternately, the closure may be separated from the sample by a closure liner that is inert to the sample material such as PTFE sheeting. If soil or sediment samples are being collected, the threads of the container must be wiped clean with a dedicated paper towel or cloth, so the cap can be threaded properly.

e. Decontamination of Sample Containers

Sample containers must be laboratory cleaned by the laboratory performing the analysis. The cleaning procedure is dictated by the specific analysis to be performed on the sample. Sample containers must be carefully examined to ensure that all containers appear clean. Do not mistake the preservative as unwanted residue. The bottles should not be field cleaned. If there is any question regarding the integrity of the bottle, then the laboratory must be contacted immediately and the bottle(s) replaced.

f. Sample Bottle Storage and Transport

No matter where the sample bottles are, whether at the laboratory waiting to be packed for shipment or in the field waiting to be filled with sample, care must be taken to avoid contamination. Sample shuttles or coolers, and sample bottles must be stored and transported in clean environments. Sample bottles and clean sampling equipment must never be stored near solvents, gasoline, or other equipment that is a potential source of cross-contamination. When under chain of custody, sample bottles must be secured in locked vehicles, and custody sealed in shuttles or in the presence of authorized personnel. Information which documents that proper storage and transport procedures have been followed must be included in the field notebook and on appropriate field forms.

2.2 Decontamination of Sampling Equipment

Proper decontamination of all re-usable sampling equipment is critical for all sampling episodes. The SOP for Decontamination of Field Equipment and SOPs for method-specific or instrument-specific tasks must also be referred to for guidance for decontamination of various types of equipment.

2.3 Quality Assurance/Quality Control Samples

QA/QC samples are intended to provide control over the proper collection and tracking of environmental measurements, and subsequent review, interpretation and validation of generated analytical data. The SOPs for Collection of Quality Control Samples, for Evaluation and Validation of Data, and for Field Record Keeping and Quality Assurance/Quality Control must be referred to for detailed guidance regarding these respective procedures. SOPs for method-specific or instrument-specific tasks must also be referred to for guidance for QA/QC procedures.

2.4 Sample Preservation Requirements

Certain analytical methodologies for specific analytes require chemical additives in order to stabilize and maintain sample integrity. Generally, this is accomplished under the following two scenarios:

a. Sample bottles are preserved at the laboratory prior to shipment into the field.

b. Preservatives are added in the field immediately after the samples are collected.

Many laboratories provide pre-preserved bottles as a matter of convenience and to help ensure that samples will be preserved immediately upon collection. A problem associated with this method arises if not enough sample could be collected, resulting in too much preservative in the sample. More commonly encountered problems with this method include the possibility of insufficient preservative provided to achieve the desired pH level or the need for additional preservation due to chemical reactions caused by the addition of sample liquids to pre-preserved bottles. The use of pre-preserved bottles is acceptable; however, field sampling teams must always be prepared to add additional preservatives to samples if the aforementioned situations occur. Furthermore, care must be exercised not to overfill sample bottles containing preservatives to prevent the sample and preservative from spilling and therefore diluting the preservative (i.e., not having enough preservative for the volume of sample).

When samples are preserved after collection, special care must be taken. The transportation and handling of concentrated acids in the field requires additional preparation and adherence to appropriate preservation procedures. All preservation acids used in the field should be trace-metal or higher-grade.

2.5 Sample Handling

After the proper sample bottles have been received under chain-of-custody, properly decontaminated equipment has been used to collect the sample, and appropriate preservatives have been added to maintain sample integrity, the final step for the field personnel is checking the sample bottles prior to proper packing and delivery of the samples to the laboratory.

All samples should be organized and the labels checked for accuracy. The caps should be checked for tightness and any 40-ml volatile organic compound (VOC) bottles must be checked for bubbles. Each sample bottle must be placed in an individual Ziploc® bag to protect the label, and placed on ice. The bottles must be carefully packed to prevent breakage during transport. When several bottles have been collected for an individual sample, they should not be placed adjacent to each other in the cooler to prevent possible breakage of all bottles for a given sample. If there are any samples which are known or suspected to be highly

contaminated, these should be placed in an individual cooler under separate chain-of-custody to prevent possible cross contamination. Sufficient ice (wet or blue packs) should be placed in the cooler to maintain the temperature at 4 degrees Celsius (°C) until delivery at the laboratory. Consult the work plan to determine if a particular ice is specified as the preservation for transportation (e.g., the United States Environmental Protection Agency does not like the use of blue packs because they claim that the samples will not hold at 4°C). If additional coolers are required, then they should be purchased. The chain-of-custody form should be properly completed, placed in a "zip-lock" bag, and placed in the cooler. One copy must be maintained for the project files. The cooler should be sealed with packing tape and a custody seal. The custody seal number should be noted in the field book. Samples collected from Monday through Friday will be delivered to the laboratory within 24 hours of collection. If Saturday delivery is not available, samples collected on Friday must be delivered by Monday morning. Check the work plan to determine if certain analytes require a shorter delivery time. If overnight mail is utilized, then the shipping bill must be maintained for the files and the laboratory must be called the following day to confirm receipt.

3.0 EQUIPMENT AND MATERIALS

3.1 General equipment and materials may include, but not necessarily be limited to, the following:

a. Sample bottles of proper size and type with labels.

b. Cooler with ice (wet or blue pack).

c. Field notebook, appropriate field form(s), chain-of-custody form(s), custody seals.

d. Black pen and indelible marker.

e. Packing tape, "bubble wrap," and "zip-lock" bags.

f. Overnight (express) mail forms and laboratory address.

g. Health and safety plan (HASP).

h. Work plan/scope of work.

i. Pertinent SOPs for specified tasks and their respective equipment and materials.

3.2 Preservatives for specific samples/analytes as specified by the laboratory. Preservatives must be stored in secure, spillproof glass containers with their content, concentration, and date of preparation and expiration clearly labeled.

3.3 Miscellaneous equipment and materials including, but not necessarily limited to, the following:

a. Graduated pipettes.

b. Pipette bulbs.

c. Litmus paper.

d. Glass stirring rods.

e. Protective goggles.

f. Disposable gloves.

g. Lab apron.

h. First aid kit.

i. Portable eye wash station.

j. Water supply for immediate flushing of spillage, if appropriate.

k. Shovel and container for immediate containerization of spillage-impacted soils, if appropriate.

4.0 PROCEDURE

4.1 Examine all bottles and verify that they are clean and of the proper type, number, and volume for the sampling to be conducted.

4.2 Label bottles carefully and clearly with project name and number, site location, sample identification, date, time, and the sampler's initials using an indelible marker.

4.3 Collect samples in the proper manner (refer to specific sampling SOPs).

4.4 Conduct preservation activities as required after each sample has been collected. Field preservation must be done immediately and must not be done later than 30 minutes after sample collection.

4.5 Conduct QC sampling, as required.

4.6 Seal each container carefully and place in an individual "zip lock" bag.

4.7 Organize and carefully pack all samples in the cooler immediately after collection (e.g., bubble wrap). Insulate samples so that breakage will not occur.

4.8 Complete and place the chain-of-custody form in the cooler after all samples have been collected. Maintain one copy for the project file. If the cooler is to be transferred several times prior to shipment or delivery to the laboratory, it may be easier to tape the chain-of-custody to the exterior of the sealed cooler. When exceptionally hazardous samples are known or suspected to be present, this should be identified on the chain-of-custody as a courtesy to the laboratory personnel.

4.9 Add additional ice as necessary to ensure that it will last until receipt by the laboratory.

4.10 Seal the cooler with packing tape and a custody seal. Record the number of the custody seal in the field notebook and on the field form. If there are any exceptionally hazardous samples, then shipping regulations should be examined to ensure the sample containers and coolers are in compliance and properly labeled.

4.11 Samples collected from Monday through Friday will be delivered to the laboratory within 24 hours of collection. If Saturday delivery is not available, samples collected on Friday must be delivered by Monday morning. Check the work plan to determine if certain analytes require a shorter delivery time.

4.12 Maintain the shipping bill for the project files if overnight mail is utilized and call the laboratory the following day to confirm receipt.

END OF PROCEDURE

ATTACHMENT 5

Laboratory Chains of Custody

Eurofins TestAmerica, Edison
777 New Durham Road

Edison, NJ 08817-2859
phone 732.549.3900 fax 732.549.3679

Chain of Custody Record

eurofins | Environment Testing America

Regulatory Program: ☐ DW ☐ NPDES ☐ RCRA ☐ Other:

TestAmerica Laboratories, Inc. d/b/a Eurofins TestAmerica

	Project Manager:		COC No:
Client Contact	**Email:**	**Site Contact:**	**Date:**	_____ of _____ COCs
Your Company Name here	**Tel/Fax:**	**Lab Contact:**	**Carrier:**	TALS Project #:
Address	**Analysis Turnaround Time**			Sampler:
City/State/Zip	☐ CALENDAR DAYS ☐ WORKING DAYS			**For Lab Use Only:**
(xxx) xxx-xxxx Phone	TAT if different from Below _____			Walk-in Client:
(xxx) xxx-xxxx FAX	☐ 2 weeks			Lab Sampling:
Project Name:	☐ 1 week			
Site:	☐ 2 days			Job / SDG No.:
P O #	☐ 1 day			

Sample Identification	Sample Date	Sample Time	Sample Type (C=Comp, G=Grab)	Matrix	# of Cont.	Filtered Sample (Y / N)	Perform MS / MSD (Y / N)																Sample Specific Notes:

Preservation Used: 1= Ice, 2= HCl; 3= H_2SO_4; 4=HNO_3; 5=NaOH; 6= Other _____

Possible Hazard Identification:
Are any samples from a listed EPA Hazardous Waste? Please List any EPA Waste Codes for the sample in the Comments Section if the lab is to dispose of the sample.

☐ Non-Hazard ☐ Flammable ☐ Skin Irritant ☐ Poison B ☐ Unknown

Sample Disposal (A fee may be assessed if samples are retained longer than 1 month)

☐ Return to Client ☐ Disposal by Lab ☐ Archive for_____ Months

Special Instructions/QC Requirements & Comments:

Custody Seals Intact: ☐ Yes ☐ No | Custody Seal No.: | Cooler Temp. (°C): Obs'd:_____ Corr'd:_____ Therm ID No.:_____

Relinquished by:	Company:	Date/Time:	Received by:	Company:	Date/Time:
Relinquished by:	Company:	Date/Time:	Received by:	Company:	Date/Time:
Relinquished by:	Company:	Date/Time:	Received in Laboratory by:	Company:	Date/Time:

Eurofins TestAmerica, Burlington
30 Community Drive
Suite 11
South Burlington, VT 05403-6809
phone 802.660.1990 fax 802.660.1919

Chain of Custody Record

eurofins | Environment Testing America

Regulatory Program: ☐ DW ☐ NPDES ☐ RCRA ☐ Other:

TestAmerica Laboratories, Inc. d/b/a Eurofins TestAmerica

	Project Manager:		COC No:
Client Contact	**Email:**	**Site Contact:**	**Date:**	_____ of _____ COCs
Your Company Name here	**Tel/Fax:**	**Lab Contact:**	**Carrier:**	TALS Project #:
Address	**Analysis Turnaround Time**			Sampler:
City/State/Zip	☐ CALENDAR DAYS ☐ WORKING DAYS			**For Lab Use Only:**
(xxx) xxx-xxxx Phone	TAT if different from Below _____			Walk-in Client:
(xxx) xxx-xxxx FAX	☐ 2 weeks			Lab Sampling:
Project Name:	☐ 1 week			
Site:	☐ 2 days			Job / SDG No.:
P O #	☐ 1 day			

Sample Identification	Sample Date	Sample Time	Sample Type (C=Comp, G=Grab)	Matrix	# of Cont.	Filtered Sample (Y / N)	Perform MS / MSD (Y / N)																Sample Specific Notes:

Preservation Used: 1= Ice, 2= HCl; 3= H_2SO_4; 4=HNO_3; 5=NaOH; 6= Other _____

Possible Hazard Identification:
Are any samples from a listed EPA Hazardous Waste? Please List any EPA Waste Codes for the sample in the Comments Section if the lab is to dispose of the sample.

☐ Non-Hazard ☐ Flammable ☐ Skin Irritant ☐ Poison B ☐ Unknown

Sample Disposal (A fee may be assessed if samples are retained longer than 1 month)

☐ Return to Client ☐ Disposal by Lab ☐ Archive for_____ Months

Special Instructions/QC Requirements & Comments:

Custody Seals Intact: ☐ Yes ☐ No | Custody Seal No.: | Cooler Temp. (°C): Obs'd:_____ Corr'd:_____ Therm ID No.:_____

Relinquished by:	Company:	Date/Time:	Received by:	Company:	Date/Time:
Relinquished by:	Company:	Date/Time:	Received by:	Company:	Date/Time:
Relinquished by:	Company:	Date/Time:	Received in Laboratory by:	Company:	Date/Time:

Eurofins TestAmerica, Edison
777 New Durham Road

Edison, NJ 08817-2859
phone 732.549.3900 fax 732.549.3679

Canister Samples Chain of Custody Record

TestAmerica Laboratories, Inc. assumes no liability with respect to the collection and shipment of these samples.

eurofins | Environment Testing America

TestAmerica Laboratories, Inc. d/b/a Eurofins TestAmerica

Client Contact Information	**Client Project Manager:**	**Samples Collected By:**	COC No:
Company Name:	**Phone:**		_____ of _____ COCs
Address:	**Email:**		TALS Project #:
City/State/Zip			**For Lab Use Only:**
Phone:	**Site Contact:**		Walk-in Client:
FAX:	**Tel/Fax**		Lab Sampling:
Project Name:	**Analysis Turnaround Time**		
Site/Location:	Standard (Specific):_____		Job / SDG No.:
P O #	Rush (Specifiy):_____		(See below for Add'l Items)

Sample Identification	**Sample Start Date**	**Time Start**	**Sample End Date**	**Time Stop**	**Canister Vacuum in Field, "Hg (Start)**	**Canister Vacuum in Field, "Hg (Stop)**	**Flow Controller ID**	**Canister ID**	**TO-14/15 (Standard / Low Level)**	**TO-15 SIM**	**EPA 3C**	**EPA 25C**	**ASTM D-1946**	**EPA 15/16**	**Other** (Please specify in notes section)	***Sample Type***	**Indoor Air/Ambient Air**	**Sub-Slab**	**Soil Gas**	**Soil Vapor Extraction (SVE)**	**Landfill Gas**	**Other** (Please specify in notes section)	**Sample Specific Notes:**

	Temperature (Fahrenheit)			
	Start	**Interior**	**Ambient**	
	Stop			

	Pressure (inches of Hg)			
	Start	**Interior**	**Ambient**	
	Stop			

Special Instructions/QC Requirements & Comments:

Samples Shipped by:	**Date / Time:**	**Samples Received by:**	
Samples Relinquished by:	**Date / Time:**	**Received by:**	
Relinquished by:	**Date / Time:**	**Received by:**	

Lab Use Only: **Shipper Name:** **Opened by:** **Condition:**

APPENDIX C

Community Air Monitoring Plan

Community Air Monitoring Plan

Broadway Triangle Site C
Block 2269
Lots 25, 27, 28, 30, 31, 35, 36
59-69 Bartlett Street,
84-100 Throop Avenue,
90-100 Gerry Street
Brooklyn, New York 11206

July 30, 2021

Prepared for:

Unified Neighborhood Partners LLC
2 Kingsland Avenue
Brooklyn, New York 11211

Prepared by:

Roux Environmental Engineering and Geology, D.P.C.
209 Shafter Street
Islandia, New York 11749

3605.0001Y116/CV

Environmental Consulting
& Management
+1.800.322.ROUX
rouxinc.com

Table of Contents

1. Introduction 1
   1.1 VOC Monitoring Approach 1
   1.2 Particulate Monitoring, Response Levels and Actions 2
   1.3 Meteorological Monitoring 2
   1.4 Available Suppression Techniques 3
   1.5 Reporting 3

Table

1. Action Limit Summary for VOCs and Particulates

Appendices

A. Action Limit Report

1. Introduction

Roux Environmental Engineering and Geology, D.P.C. (Roux) on behalf of Unified Neighborhood Partners LLC, (the "Requestor"), has developed a project specific Community Air Monitoring Plan (CAMP) to implement real time monitoring at the Site, which occupies Tax Lots 25, 27, 28, 30, 31, 35, and 36 of Tax Block 2269, during remedial investigation activities.

The monitoring program will be implemented at all times during which earth disturbance activities are occurring. The CAMP is designed to provide a measure of protection for the downwind community and on-Site workers not directly involved with the subject work activities from potential airborne contaminant releases as a direct result of remedial and construction activities. This plan is consistent with the New York State Department of Health (NYSDOH) Generic Community Air Monitoring Plan guidance document.

The specifics of the CAMP are presented in the following four (4) sections:

- 1.1 Volatile Organic Compound (VOC) Monitoring Approach
- 1.2 Particulate Monitoring Approach
- 1.3 Meteorological Monitoring Approach
- 1.4 Available Suppression Techniques

1.1 VOC Monitoring Approach

Total VOC concentrations in air will be monitored continuously at a location downwind of the investigation activities during all ground intrusive activities. An upwind monitoring station will be set up adjacent to where the intrusive activities are occurring. The VOC monitoring equipment will be located at temporary monitoring stations that will be established daily based on Site logistics and weather conditions. The monitoring work will be conducted using MiniRAE 3000 (or equivalent) portable VOC monitors, or similar type monitors, for all VOC monitoring. The equipment will be calibrated at least once daily using isobutylene as the calibration gas. One (1) upwind and one (1) downwind monitor will be deployed each day. Each monitoring unit is equipped with an audible alarm to indicate exceedance of the action levels (as defined below and summarized in Table 1).

The equipment is capable of calculating 15-minute running average concentrations, which will be compared to the levels specified below.

- If the ambient air concentration of total VOCs at the downwind perimeter of the Site exceeds 5 parts per million (ppm) above background for the 15-minute average, work activities must be temporarily halted and monitoring continued. If the total organic vapor level readily decreases (per instantaneous readings) below 5 ppm over background, work activities can resume with continued monitoring.
- If the ambient air concentration of total VOCs at the downwind perimeter of the Site persists at levels in excess of 5 ppm over background but less than 25 ppm, work activities must be halted, the source of VOCs identified, suppression techniques employed to abate emissions, and monitoring continued. After these steps, work activities can resume if the total organic vapor level at the Site perimeter is below 5 ppm over the background concentration for the 15-minute average. If levels are in excess of 25 ppm above background, identified contributing ground-intrusive activities will be halted and vapor suppression techniques will be evaluated and modified until monitoring indicates VOC levels at the Site perimeter are below 5 ppm over background. Once VOC levels are below 5 ppm at the Site perimeter, work will resume with continued monitoring.

- All 15-minute readings will be recorded and be available for State Regulator (New York State Department of Environmental Conservation [NYSDEC] and NYSDOH) personnel to review. Instantaneous readings, if any, used for decision purposes will be recorded. If an exceedance of the action level occurs, an Action Limit Report (ALR) will be completed, identifying the monitoring device location, the measured VOC level, the activity causing the exceedance, meteorological conditions, and the corrective actions taken, as provided in Appendix A. Additionally, the NYSDEC and NYSDOH will be notified within 24 hours of the VOC ALR generation. Daily monitoring equipment locations and meteorological conditions will also be documented on the daily CAMP Monitoring Location Plan. All documentation will be kept on file at the Site.

1.2 Particulate Monitoring, Response Levels and Actions

Particulate concentrations will be monitored continuously at temporary particulate monitoring stations set up at the sidewalk at upwind and downwind locations. The particulate monitoring will be performed using real-time monitoring equipment capable of measuring particulate matter less than 10 micrometers in size (PM-10) and capable of integrating over a period of 15 minutes (or less) for comparison to the airborne particulate action levels (as defined below and summarized in Table 1). Monitoring equipment will be TSI DustTrak II monitors or equivalent. A minimum of one (1) upwind and one (1) downwind monitor will be deployed each day, equipped with an omni-directional sampling inlet and a PM-10 sample head. The data logging averaging period will be set to 15-minutes with time and date stamp recording. Alarm averaging will be set at 90 micrograms per cubic meter (µg/m^3) per 15-minute period. This setting will allow proactive evaluation of Site conditions prior to reaching Action Levels of 100 µg/m^3 above background. The equipment will be outfitted with an audible alarm to indicate exceedance of the action level. In addition, fugitive dust migration will be visually assessed during all work activities. The monitoring will be used to compare values to the following:

- If the downwind PM-10 particulate level is 100 µg/m^3 greater than background (upwind perimeter) for the 15-minute period or if airborne dust is observed leaving the Site, then dust suppression techniques must be employed. Work may continue with dust suppression techniques provided that downwind PM-10 particulate levels do not exceed 150 µg/m^3 above the upwind level and provided that no visible dust is migrating from the Site.
- If, after implementation of dust suppression techniques, downwind PM-10 particulate levels are greater than 150 µg/m^3 above the upwind level, work must be stopped, a re-evaluation of activities initiated, and dust suppression techniques modified. Work can resume provided that dust suppression measures and other controls are successful in reducing the downwind PM-10 particulate concentration to within 150 µg/m^3 of the upwind level and in preventing visible dust migration.

All 15-minute readings will be recorded and be available for State Regulator (NYSDEC and NYSDOH) personnel to review. Instantaneous readings, if any, used for decision purposes will be recorded. If an exceedance of the action level occurs, an ALR will be completed, identifying the monitoring device location, the measured particulate concentration, the activity causing the exceedance, meteorological conditions, and the corrective actions taken, as provided in Appendix A. Daily monitoring equipment locations will also be documented on the daily CAMP Monitoring Location Plan. All documentation will be kept on file at the Site.

1.3 Meteorological Monitoring

Wind speed (estimated) and wind direction, will be approximated based on field observations of on-Site personnel. Meteorological data consisting of temperature, barometric pressure, and relative humidity will be recorded in the field book based upon publically available information from local weather stations.

1.4 Available Suppression Techniques

Odor Control

Due to the nature of the project, with intrusive activities occurring, the potential for generation of nuisance odors and the need for odor control may be necessary. If nuisance odors are identified, work will be halted and the source of odors will be identified and corrected. Work will not resume until all nuisance odors have been abated. Both NYSDEC and NYSDOH will be notified of all nuisance odor events and of all other complaints about the project.

All necessary means will be employed to prevent on- and off-Site nuisances. At a minimum, procedures will include: (a) limiting the area of open excavations; (b) shrouding open excavations with tarps and other covers; and (c) using foams to cover exposed odorous soils. If odors develop and cannot be otherwise controlled, additional means to eliminate odor nuisances will include: (d) use of chemical odorants in spray or misting systems; and, (e) use of staff to monitor odors in surrounding neighborhoods.

Dust Control

Due to the nature of the project, the potential for generation of nuisance dust and the need for dust control may be necessary. Dust suppression will be achieved through the use of water for wetting excavation areas, if required. Water will be available on-Site at suitable supply and pressure for use in dust control.

1.5 Reporting

All recorded monitoring data will be downloaded, and field logged periodically, including action limit reports (if any) and daily CAMP monitoring location plans. All records will be maintained on-Site and available for NYSDEC/NYSDOH review. A summary of CAMP findings, including excursions, will be provided in the Daily and Monthly Reports. All CAMP monitoring records will be included in the overall Final Engineering Report (FER) that will be submitted to the NYSDEC and NYSDOH and will include all of the CAMP data collected, daily monitoring station location maps, and copies of the ALRs (if any). If an ALR is generated due to VOC exceedances, the NYSDEC and NYSDOH will be notified within 24 hours of the exceedance.

TABLES

1. Action Limit Summary for VOCs and Particulates

Table 1. Action Limit Summary for VOCs and Particulates, Broadway Triangle Site C, Brooklyn, NY

Contaminant	Downwind Action Levels*	Action/Response
Volatile Organic Compounds (VOCs) (Monitoring Via Photoionization Detector and Odor Observation)	< 5 ppm	1. Resume work with continuing monitoring.
	5 ppm < level < 25 ppm	1. Work activities must be temporarily halted, source vapors must be identified, suppression techniques employed to abate emissions and monitoring continued. 2. After these steps, if VOC levels (200 feet downwind of the exclusion zone or half the distance to the nearest potential receptor or structure, whichever is less) is below 5 ppm over background, resume work.
	> 25 ppm	1. Identified contributing ground intrusive activities must be halted and vapor suppression techniques must be evaluated and modified until monitoring indicates VOC levels below the action level. 2. After these steps, if VOC levels (half the distance to the nearest potential receptor or structure) are below 5 ppm over background, resume work.
Particulates (Monitoring Via Particulate Meter and Observation)	< 100 ug/m^3	1. If dust is observed leaving the work area, then dust control techniques must be implemented or additional controls used.
	100 ug/m3 < level < 150 ug/m^3	1. Employ dust suppression techniques. 2. Work may continue with dust suppression techniques provided that downwind PM-10 particulate concentration do not exceed 150 ug/m^3 above the upwind level and provided that no visible dust is migrating from the work area.
	> 150 ug/m^3	1. STOP work 2. Re-evaluate activities, modify dust suppression techniques. Work can resume provided that dust suppression measures and other controls are successful in reducing the downwind PM-10 particulate concentration to within 150 ug/m^3 of the upwind level and in preventing visible dust migration.

* Instantaneous readings above background. Particulate readings are based on the respirable (PM-10) fraction. Background readings are taken at upwind locations relative to Work Areas or Exclusion Zones.

APPENDIX A

Action Limit Report

ACTION LIMIT REPORT

Project Location: Broadway Triangle Site C
Tax Block 2269 Lots 25, 27, 28, 30, 31, 35, 36

Date: _____ Time: _____

Name: _____

Contaminant: PM-10: _____ VOC: _____

Wind Speed: _____ Wind Direction: _____

Temperature: _____ Barometric Pressure: _____

DOWNWIND DATA

Monitor ID #: _____ Location: _____ Level Reported: _____

Monitor ID#: _____ Location: _____ Level Reported: _____

UPWIND DATA

Monitor ID #: _____ Location: _____ Level Reported: _____

Monitor ID#: _____ Location: _____ Level Reported: _____

BACKGROUND CORRECTED LEVELS

Monitor ID #: _____ Location: _____ Level Reported: _____

Monitor ID#: _____ Location: _____ Level Reported: _____

ACTIVITY DESCRIPTION

CORRECTIVE ACTION TAKEN

APPENDIX D

Site Specific Health and Safety Plan
(Provided on CD in Bound Copy)

Site-Specific Health and Safety Plan

Broadway Triangle Site C
Block 2269
Lots 25, 27, 28, 29, 30, 31, 33, 35, 36
59-69 Bartlett Street, 84-100 Throop Avenue,
90-100 Gerry Street
Brooklyn, New York 11206

July 30, 2021

Prepared for:

Unified Neighborhood Partners LLC
2 Kingsland Avenue
Brooklyn, New York 11211

Prepared by:

Roux Environmental Engineering and Geology, D.P.C.
209 Shafter Street
Islandia, New York 11749

3605.0001Y113/CV

Environmental Consulting
& Management
+1.800.322.ROUX
rouxinc.com

Table of Contents

Site-Specific Emergency Information 1
Emergency Phone Numbers 1

1. Introduction 3
1.1 Roles and Responsibilities 3

2. Background 6
2.1 Site Description 6
2.2 Site History 6
2.3 Known and Potential Releases of Hazardous Substances at the Site 6

3. Scope of Work 7

4. Site Control 8
4.1 Site Map 8
4.2 Site Access 8
4.3 Buddy System 8
4.4 Site Communications 8
4.5 Site Work Zones 9

5. Job Hazard Evaluation 10
5.1 Hazard Communication and Overall Site Information Program 11
5.2 Noise 11
5.3 Biological Hazards 11

6. Emergency Response Plan 12
6.1 Emergency Response 12
6.2 Emergency Alerting and Evacuation 12
6.3 Emergency Medical Treatment and First Aid 12
6.4 Adverse Weather Conditions 13
6.5 Electrical Storm Guidelines 14

7. Safety Procedures 15
7.1 Training 15
7.2 Site-Specific Safety Briefings for Visitors 15
7.3 HASP Information and Site-Specific Briefings for Workers 15
7.4 Medical Surveillance 16
7.4.1 Site Medical Surveillance Program 16
7.4.2 Medical Recordkeeping Procedures 16
7.4.3 Program Review 16
7.5 Personnel Protection 17
7.5.1 Hearing Conservation 17
7.6 Monitoring 18
7.6.1 Action Levels for Air Monitoring 18
7.6.2 Air Monitoring Equipment and Calibration 20
7.7 Tailgate Safety Meetings 20
7.8 Spill Containment 21

Table of Contents (Continued)

7.8.1 Initial Spill Notification and Response 21
7.8.2 Spill Evaluation and Response 21
7.9 Decontamination 21
7.9.1 Decontamination Procedures for Personnel and PPE 21
7.9.2 Decontamination Procedures for Equipment 22
7.9.3 Monitoring the Effectiveness of Decontamination Procedures 22
7.10 Confined Space Entry 23
7.11 Client and Site-Specific 23
7.12 Unusual or Significant Risks 23
7.13 Activity-Specific Hazards 24
7.13.1 Electrical and Other Utility Assessment and Accommodations 24
7.13.2 Subsurface Work 24
7.13.2.1 Excavations and Trenching 24
7.13.3 Heavy Equipment 25
7.14 Heat Stress 25
7.14.1 Heat Stress 26
7.14.2 Heat Exhaustion 26
7.14.3 Heat Stroke 26
7.15 Cold Stress 27
8. Field Team Review 28
9. Approvals 29

Tables

1. Toxicological Properties of Hazardous Substances Present at the Site

Figures

1. Site Location Map
2. Site Plan with Emergency Muster Area
3. Routes to Urgent Care and Hospital

Appendices

A. Job Safety Analysis (JSA) Forms
B. SDSs for Chemicals Used
C. COVID-19 Interim Health and Safety Guidance
D. Personal Protective Equipment (PPE) Management Program
E. Subsurface Utility Clearance Management Program
F. Heavy Equipment Exclusion Zone Policy
G. Incident Investigation and Reporting Management Program

Site-Specific Emergency Information

Emergency Phone Numbers

Most emergency services can be obtained by calling **911**. Where 911 service is not available, use the telephone numbers provided in the below table. The following is a master emergency phone list for use by the project management personnel. A more condensed version of the emergency numbers listed below will be posted throughout project work areas. Emergencies encountered on the site will be responded to by a combination of off-site emergency services and on-site personnel.

Emergency Contact Information			
Site Personnel			
Title	**Contact**		**Telephone**
Office Manager (OM)	Michael Ritorto, P.G.		(630) 630-2370
Project Principal (PP)	Jessica Taylor, P.G.		(631) 766-0607
Project Manager (PM)	Brandon Vella		(516) 554-4220
Site Supervisor (SS)	Emily Butler		(719) 494-6722
Site Health and Site Safety Officer (SHSO)	Emily Butler		(719) 494-6722
Office Health and Safety Manager (OHSM)	Kristina DeLuca		(516) 830-1189
Corporate Health and Safety Manager (CHSM)	Brian Hobbs, CIH, CSP		(631) 807-0193
AllOne Health	Occupational Health Care Management Provider		(800) 350-4511
Client Emergency Contact	Drew Vanderburg		(718) 366-3800 x 1039
Outside Assistance			
Agency	**Contact**	**Telephone**	**Address/Location**
Ambulance/emergency medical services (EMS)	ModernMD Urgent Care – S.E. Williamsburg NYC Health + Hospitals/Woodhull	(646) 604-8120 (718) 963-8000	68 Graham Avenue Brooklyn, NY 11206 760 Broadway Brooklyn, NY 11206
Police	New York City Police Department 88th Precinct	(718) 636-6511	298 Classon Ave, Brooklyn, NY 11206
Fire	FDNY Engine 237	(805) 458-1207	43 Morgan Ave, Brooklyn, NY 11237
Site Address	59-69 Bartlett Street, 84-100 Throop Ave and 90-100 Gerry St, Brooklyn, NY 11206		

ModernMD Urgent Care – S.E. Williamsburg:

- Head south toward Flushing Avenue and turn onto Flushing Avenue heading east
- Turn left onto Broadway then quick right onto Graham Avenue/Avenue of Puerto Rico heading north
- Destination will be on your right

NYC Health + Hospitals/Woodhull:

- Head south toward Flushing Avenue and turn onto Flushing Avenue heading west
- From Flushing Avenue turn onto Tomkins Avenue heading south
- Turn left onto Park Avenue heading east
- Destination will be on your left

1. Introduction

This Site-specific Health and Safety Plan (HASP) has been prepared by Roux Environmental Engineering and Geology, D.P.C. (Roux) for use during the sampling and remedial activities being performed by Roux at the Broadway Triangle Site C on behalf of Unified Neighborhood Partners LLC , located in Brooklyn, NY. (Site; **Figure 1**). These activities fall within the scope of operations covered by the Occupational Safety and Health Administration (OSHA) standards promulgated at 29 CFR 1910.120 and 29 CFR 1926.65, both commonly referred to as the Hazardous Waste Operations and Emergency Response (HAZWOPER) Standard. In accordance with the HAZWOPER Standard, this Site-specific HASP was prepared to address the safety and health hazards associated with the drilling, monitoring well installation, ground water sampling, and soil vapor sampling activities being performed at the Site by Roux and to provide requirements and procedures for the protection of Roux employees, subcontractor personnel, government oversight personnel, Site personnel, and the general public. It also addresses client- and Site-specific requirements for health and safety. Additionally, subcontractors may be required to submit their own HASP as it relates to their specific work activities and will be kept onsite during such work.

Implementation of this HASP is the joint responsibility of the Project Manager (PM), the Site Health and Safety Officer (SHSO), and all field staff, with assistance from the Project Principal (PP), Office Health and Safety Manager (OHSM), and Corporate Health and Safety Manager (CHSM). The PM for this project is Brandon Vella . The Site Supervisor (SS) and Site Health and Safety Officer (SHSO) is Emily Butler.

This HASP will be introduced to, reviewed, and signed off on by all Roux personnel through a formal training session prior to commencing work. A copy of the HASP will be kept at the Site at all times. The Roux SHSO or PM will be responsible for posting any changes, amendments, memos, etc. to the HASP. Any revisions to this HASP will be signed by appropriate personnel, which can include Roux's PP, CHSM, and SS. Any changes will be announced to all workers at the next safety meeting.

1.1 Roles and Responsibilities

Overall Roles and Responsibilities (R&Rs) of Roux personnel are provided in Roux's Policies and Procedures Manual. Only those R&Rs specific to HASP requirements are listed below.

Project Manager (PM)

The PM has responsibility and authority to direct all work operations. The PM coordinates safety and health functions with the Site Health and Safety Officer (SHSO), has the authority to oversee and monitor the performance of the SHSO, and bears ultimate responsibility for the proper implementation of this HASP. The specific duties of the PM are:

- Preparing and coordinating the Site work plan;
- Providing Site supervisor(s) with work assignments and overseeing their performance; Coordinating safety and health efforts with the SSHO;
- Ensuring effective emergency response through coordination with the Emergency Response Coordinator (ERC); and
- Serving as primary Site liaison with public agencies and officials and Site contractors.

Site Health and Safety Officer (SHSO)

The SHSO has the full responsibility and authority to develop and implement this HASP and to verify compliance. The SHSO reports to the Project Manager. The SHSO is on Site or readily accessible to the Site during all work operations and has the authority to halt Site work if unsafe conditions are detected. The specific responsibilities of the SHSO include:

- Managing the safety and health functions on this Site;
- Serving as the Site's point of contact for safety and health matters;
- Ensuring Site monitoring, worker training, and effective selection and use of PPE;
- Assessing Site conditions for unsafe acts and conditions and providing corrective action;
- Assisting the preparation and review of this HASP;
- Maintaining effective safety and health records as described in this HASP; and
- Coordinating with the Site Supervisor(s) and others as necessary for safety and health efforts.

Site Supervisor

The Site Supervisor is responsible for field operations and reports to the Project Manager (PM). The Site Supervisor ensures the implementation of the HASP requirements and procedures in the field. The specific responsibilities of the Site Supervisor include:

- Executing the work plan and schedule as detailed by the PM;
- Coordination with the SHSO on safety and health; and
- Ensuring Site work compliance with the requirements of this HASP.

Employees

All Roux employees are responsible for reading and following all provisions of the Corporate Health and Safety Manual, including this HASP. Employees report to the SS at the project Site. Each employee is also responsible for the following:

- Wearing all appropriate PPE as outlined within this HASP;
- Attending all safety meetings;
- Inspecting tools and equipment prior to use, and taking any defective tools or equipment out of service;
- Appropriately documenting field events as they occur within a logbook or equivalent;
- Properly operating machinery and/or equipment only if trained to do so;
- Stopping work operations if unsafe conditions exist;
- Identifying and mitigating hazards when observed;
- Reporting all incidents and near misses to the Roux SHSO and SS immediately; and
- Knowing where emergency equipment is located (e.g., first aid kit, fire extinguisher).

Subcontractors and Visitors

Subcontractors and visitors are responsible for complying with the same health and safety requirements. It is the responsibility of all to make sure subcontractors and visitors comply and uphold the HASP. Subcontractors and visitors have the following additional responsibilities:

- Designating a qualified safety representative for the project that can make the necessary changes in work practices, as necessary;
- Attending all safety meetings while participating in Roux Site work activities;
- Reporting all incidents and near misses to Roux SHSO and SS immediately;
- Conducting initial and periodic equipment inspections in accordance with manufacturer and regulatory guidelines; and
- Providing copies of all Safety Data Sheets (SDS) to Roux SHSO for materials brought to the Site.

2. Background

Relevant background information is provided below, including a general description of the Site; a brief review of the Site's history with respect to hazardous material use, handling, and/or storage; and a review of known and potential releases of hazardous substances at the Site.

2.1 Site Description

The Sites consist of vacant land with overgrowth and building demolition debris. The planned redevelopment of the Sites entails the construction of affordable housing, retail, and community spaces. It is Roux's understanding that developers would like to enroll the Site into the New York State Department of Environmental Conservation (NYSDEC) Brownfield Cleanup Program (BCP) as a Volunteer. Data from previous investigations indicate that there is a shallow layer of fill across the Site with elevated levels of polycyclic aromatic hydrocarbons (PAHs) and metals in exceedance of the Part 375 Restricted Residential Soil Cleanup Objectives (RRSCOs), which would be the threshold for enrollment in the BCP given the proposed residential redevelopment plans.

2.2 Site History

This section of Brooklyn has an industrial past that has caused subsurface impacts in the surrounding area, including a former chemical plant that operated in this area for approximately 150 years. Chlorinated volatile organic compounds (CVOCs) have been identified in soil and groundwater adjacent to the Sites. Site C's history includes commercial and residential uses with an auto repair on Lot 35 from the 1960s to 1980s. A gasoline filling station was noted on the adjacent property to the east from the 1930s to the 1980s.

2.3 Known and Potential Releases of Hazardous Substances at the Site

The results of previous investigations show the presence of a shallow fill layer across the parcels containing predominantly elevated levels of PAHs and metals in exceedance of the Part 375 Restricted Residential Soil Cleanup Objectives. Groundwater data indicates metals were identified in concentrations above the applicable standards. Soil vapor data contains elevated concentrations of CVOCs. Petroleum odors and staining were observed in the soil on Lot 27 during the previous 2020 remedial investigation conducted by GBTS, resulting in the reporting of Spill Number 2001570 to the NYSDEC on June 3, 2020, which remains open.

3. Scope of Work

Based on information gathered as a result of previous ESAs and as part of the BCP, the purpose of the Remedial Investigation Work Plan (RIWP) is to investigate current site conditions, in preparation for redevelopment and associated remedial activities that will be covered by the Remedial Action Work Plan (e.g., source excavation) yet to be developed. The proposed RIWP scope of work includes the following:

- Installation of soil borings via direct push Geoprobe drill rig;
- Installation and sampling of monitoring wells via hallow stem auger;
- Installation and sampling of soil vapor sampling points via direct push geoprobe drill rig; and
- Subsurface utility clearance using soft dig methods (hand auger, air knife) to 5 ft bls.

Non-routine activities that may be performed by Roux personnel include the following:

- Limited site inspections;
- Oversight of Roux subcontractor personnel during horizontal/vertical datum and geophysical surveying activities; and
- Oversight of Roux subcontractor personnel during disposal of investigation-derived waste.

If there are any changes with the scope a revision of the HASP will be required to address any new hazards.

4. Site Control

This Site control program is designed to reduce the spread of hazardous substances from contaminated areas to clean areas, to identify and isolate contaminated areas of the Site, to facilitate emergency evacuation and medical care, to prevent unauthorized entry to the Site, and to deter vandalism and theft.

4.1 Site Map

A map of this Site, showing Site boundaries, designated work zones, and points of entry and exit is provided in **Figure 2**.

4.2 Site Access

Access to the work areas at the Site is restricted to reduce the potential for exposure to its safety and health hazards. During hours of Site operation, Site entry and exit is authorized only at the points identified in **Figure 2**. The property is vacant, and it is Roux's understanding that site entry and exit is authorized/controlled via locked construction gates when no activity is occurring onsite.

4.3 Buddy System

While working in the Exclusion Zone, Site workers use the buddy system. The buddy system means that personnel work in pairs and stay in close visual contact to be able to observe one another and summon rapid assistance in case of an emergency. The responsibilities of workers using the buddy system include:

- Remaining in close visual contact with partner;
- Providing partner with assistance as needed or requested;
- Observing partner for signs of heat stress or other difficulties;
- Periodically checking the integrity of partner's PPE; and
- Notifying the Site manager or other Site personnel if emergency assistance is needed.

4.4 Site Communications

The following communication equipment is used to support on-site communication: Roux and subcontractor personnel cellular phones and visual hand signals.

As applicable, hand signals will be used according to the following:

Hand Signals

SIGNAL	MEANING
Hand gripping throat	Out of air, can't breathe
Grip partner's wrist	Leave area immediately
Hands on top of head	Need assistance
Thumbs up	I'm all right, okay
Thumbs down	No, negative

A current list of emergency contact numbers is included in the Site-Specific Emergency Information at the beginning of this HASP.

4.5 Site Work Zones

This Site is divided into three (3) major zones, described below. These zones are characterized by the likely presence or absence of biological, chemical, or physical hazards and the activities performed within them. Zone boundaries are clearly marked at all times and the flow of personnel among the zones is controlled. The Site is monitored for changing conditions that may warrant adjustment of zone boundaries. Zone boundaries are adjusted as necessary to protect personnel and clean areas. Whenever boundaries are adjusted, zone markings are also changed and workers are immediately notified of the change.

Exclusion Zone

The area where contamination exists is the Exclusion Zone (EZ). All areas where excavation and handling of contaminated materials take place are considered part of the EZ. This zone will be clearly delineated by chain link fencing, caution tape, cones or other effective barriers, as necessary. Safety tape may be used as a secondary delineation within the EZ. The zone delineation markings may be opened in areas for varying lengths of time to accommodate equipment operation or specific construction activities. The SHSO may establish more than one EZ where different levels of protection may be employed or where different hazards exist. Personnel are not allowed in the EZ without:

- A buddy (co-worker);
- Required minimum level PPE;
- Medical authorization;
- Training certification; and
- Requirement to be in the zone.

Contamination Reduction Zone

A Contamination Reduction Zone (CRZ) is established between the exclusion zone and the support zone. The CRZ contains the Contamination Reduction Corridor (CRC) and provides an area for decontamination of personnel and equipment. The CRZ will be used for general Site entry and egress in addition to access for heavy equipment and emergency support services. Personnel are not allowed in the CRZ without:

- A buddy (co-worker)
- Appropriate PPE
- Medical authorization
- Training certification
- Requirement to be in the zone

Support Zone

The Support Zone (SZ) is an uncontaminated area that will be the field support area for the Site operations. The SZ will contain, if required, temporary project trailers and provisions for field team communications and staging for emergency response. Appropriate sanitary facilities and safety equipment will be located in this zone. Potentially contaminated personnel or materials are not allowed in this zone. The only exception will be appropriately packaged/decontaminated and labeled samples.

5. Job Hazard Evaluation

Roux's work at the Site is expected to entail a variety of physical, chemical, and biological hazards, all of which must be sufficiently managed to allow the work to be performed safely. Some of the hazards are Site-specific (i.e., they are associated with the nature, physical characteristics, and/or routine operation of the Site itself), while others are activity-specific (i.e., they are associated with [or arise from] the particular activity being performed). The various hazards can be grouped into the following categories:

- **Caught/Crushed** – the potential to become caught in, under, between, or by an object or parts of an object, such as equipment with parts that open and close or move up and down ("pinch points") or equipment that rotates, and the accompanying potential to have body parts cut, mangled, or crushed thereby.
- **Contact** – the potential to be struck by or against moving or stationary objects that can cause physical injury, such as heavy machinery, overhead piping, moving vehicles, falling objects, and equipment (including tools and hand-held equipment) or infrastructure with the ability to cut or impale.
- **Energy Sources** – the potential for bodily harm associated with energy sources, most notably electricity, but also including latent energy sources such as compressed air and equipment under tension (which when released could cause injurious contact or a fall).
- **Ergonomics** – the potential for musculoskeletal injury associated with lifting/carrying, pushing/pulling, bending, reaching, and other physical activity attributable to poor body position/mechanics, repetitive motion, and/or vibration.
- **Exposure** – the potential for injury/illness due to physical, chemical, or biological exposures in the work environment, including but not limited to temperature extremes, solar radiation, and noise (physical), chemical splashes and hazardous atmospheres (chemical), and animal/insect bites and poisonous plants (biological).
- **Falls** – the potential to slip or trip and thus fall or drop a load, resulting in bodily injury to oneself or others.

The foregoing is intended to provide Roux employees with a general awareness of the hazards involved with Site work. A more detailed review of the potential hazards associated with each specific activity planned for the Site (or on-going activity, as the case may be) is provided in the activity-specific Job Safety Analysis (JSA) forms in **Appendix A**. As can be seen in the JSA forms, the hazards are identified by category per the above, and specific measures designed to mitigate/manage those hazards are also identified. In preparing the JSA forms, all categories of hazards were considered, and all anticipated potential hazards were identified to the extent possible based on the experience of the personnel preparing and reviewing the JSA forms. However, there is always the possibility for an unanticipated hazard to arise, potentially as condition change over the course of the workday. Roux personnel must maintain a continual awareness of potential hazards in the work zone, regardless of whether the hazard is identified in the JSA form. Particular attention should be paid to hazards associated with exposure to hazardous substances (see **Table 1** for a listing of the hazardous substances most likely to be encountered in environmental media at the Site) and to Site personnel being located "in the line of fire" with respect to moving equipment, pinch points, and latent energy (e.g., being located or having body parts located within the swing radius of an excavator, between two sections of pipe being connected, below a piece of suspended equipment, or adjacent to a compressed air line).

5.1 Hazard Communication and Overall Site Information Program

The information in the JSAs and safety data sheets is made available to all employees and subcontractors who could be affected by it prior to the time they begin their work activities. Modifications to JSAs are communicated during routine pre-work briefings.

The information in the JSAs and Safety Data Sheets (SDSs) is made available to all employees and subcontractors who could be affected by an exposure to the hazards covered in them prior to the time they begin their work activities. Modifications to JSAs are communicated during routine pre-work briefings, and periodically updated as needed in the HASP. SDSs will be maintained by the SHSO/SS for new chemicals brought on-site as needed. Copies of SDSs can be found in **Appendix B**.

5.2 Noise

Noise is associated with the operation of heavy equipment, power tools, pumps, and generators. Noise is also a potential hazard when working near operating equipment such as excavators, drill rigs or pole drivers. High noise (i.e., < 85 dBA) operations may be evaluated by the SHSO utilizing a type 2 handheld sound level meter (SLM) operating on the "A"-weighted scale with slow response because this scale most closely resembles human response to noise and complies with OSHA 29 CFR 1910.95. Hearing protection is required in areas with noise exposure greater than 85 dBA. Double hearing protection (ear plugs and earmuffs) are required in areas where the noise exposure is more than 95 dBA. Noise exposure will be controlled by hearing protection as described above or by maintaining set-backs from high-noise equipment, as warranted. Personnel handling heavy equipment and using power tools that produce noise levels exceeding those described levels above are required by OSHA 29 CFR 1910.95 to wear the appropriate Noise Reduction Rating (NRR) level of hearing protection. Appropriate hearing protection will be evaluated by the SHSO as necessary in consultation with the OHSM and CHSM.

5.3 Biological Hazards

Biological hazards that may potentially be present at a Site, include poisonous plants, insects (ticks, spiders, bees), animals (snakes, dogs), etc. Information on biological hazards can be found within Roux's Biological Hazard Awareness Management Program located within Roux's Corporate Health and Safety Manual. There is also potential for transmission and/or exposure to SARS-CoV-2, the virus that causes COVID-19. Prior to beginning work, on-Site protocols shall be established by the project team, including subcontractors, in accordance with federal, state, county, city, and/or other guidance, as applicable and consistent with **Appendix C**. Government guidance/orders generally consist of implementation of the following protocols/procedures (or some variation thereof):

- Self-monitoring for symptoms;
- Fitness check for work each day;
- Limiting businesses to "essential" operations;
- Social distancing (generally 6 feet);
- Cloth face masks/ coverings;
- Hand washing/ disinfectant use; and
- Care/ awareness of surroundings (public spaces, equipment, hotel rooms, rental cars).

Additional guidance on minimizing potential exposure to SARS-CoV-2, including a JSA, are included in **Appendix C**.

6. Emergency Response Plan

This emergency response plan details actions to be taken in the event of Site emergencies. The PM and SHSO is responsible for the implementation of emergency response procedures onsite. The SHSO/PM provides specific direction for emergency action based upon information available regarding the incident and response capabilities and initiates emergency procedures and notification of appropriate authorities. In the event of an emergency, Site personnel are evacuated and do not participate in emergency response activities, response is facilitated through external emergency services.

6.1 Emergency Response

The SHSO, after investigating the incident and relevant information, shall determine the level of response required for containment, rescue and medical care. Limited on-site emergency response activities could occur therefore the SHSO is responsible for notifying external emergency response agencies. The SHSO provides relevant information to the responding organizations, including but not limited to the hazards associated with the emergency incident, potential containment problems, and missing Site personnel.

6.2 Emergency Alerting and Evacuation

If evacuation notice is given, Site workers leave the worksite, if possible, by way of the nearest exit. Appropriate primary and alternate evacuation routes and assembly areas have been identified and are shown on the Site Plan with Emergency Muster Area (**Figure 2**). The routes and assembly area will be determined by conditions at the time of the evacuation based on wind direction, the location of the hazard source, and other factors as determined by SHSO/PM.

Personnel exiting the Site gather at a designated assembly point. To determine that everyone has successfully exited the Site, personnel will be accounted for at the assembly point. If any worker cannot be accounted for, notification is given to the SHSO, PM, and any arriving response authorities so that appropriate action can be initiated. Subcontractors on this Site have coordinated their emergency response plans to ensure that these plans are compatible and potential emergencies are recognized, alarm systems are clearly understood, and evacuation routes are accessible to all personnel relying upon them.

6.3 Emergency Medical Treatment and First Aid

In the event of a work-related injury or illness, employees are required to follow the procedures outlined below. All work-place injury and illness situations require Roux's Project and Corporate Management Team to be notified when an injury/illness incident occurs, and communication with the contracted Occupational Health Care Management Provider, AllOne Health (AOH), is initiated. The Injury/Illness Notification Flowchart is provided below and within Roux's Incident Investigation and Reporting program included within Appendix G.

If on-Site personnel require any medical treatment, the following steps will be taken:

a. Notify Roux's Project and Corporate Management Team for any work-related injury and/or illness occurrence, and communicate with the contracted Occupational Health Care Management Provider, AOH, immediately following the notifications provided above.

b. Based on discussions with the Project Team, Corporate Management and the AOH evaluation, if medical attention beyond onsite First Aid is warranted, transport the injured / ill person (IP) to the

Urgent Care Center, or notify the Fire Department or Ambulance Emergency service and request an ambulance or transport the victim to the hospital, and continue communications with Corporate Management Team. An Urgent Care/Hospital Route map with location to ModernMD Urgent Care-S.E. Williamsburg and NYC Health + Hospitals/Woodhull is included as **Figure 3**.

c. Decontaminate to the extent possible prior to administration of first aid or movement to medical or emergency facilities.

d. First aid medical support will be provided by onsite personnel trained and certified in First Aid, Cardio Pulmonary Resuscitation (CPR), Automatic External Defibrillation (AED), and Blood-Borne Pathogens (BBP) Awareness, until relieved by emergency medical services (EMS).

e. The SHSO and Project Manager will perform a Loss Investigation (LI) and the Project Team will complete the final Loss Report. If a Roux employee is involved in a vehicular incident, the employee must also complete the Acord Automobile Loss Notice.

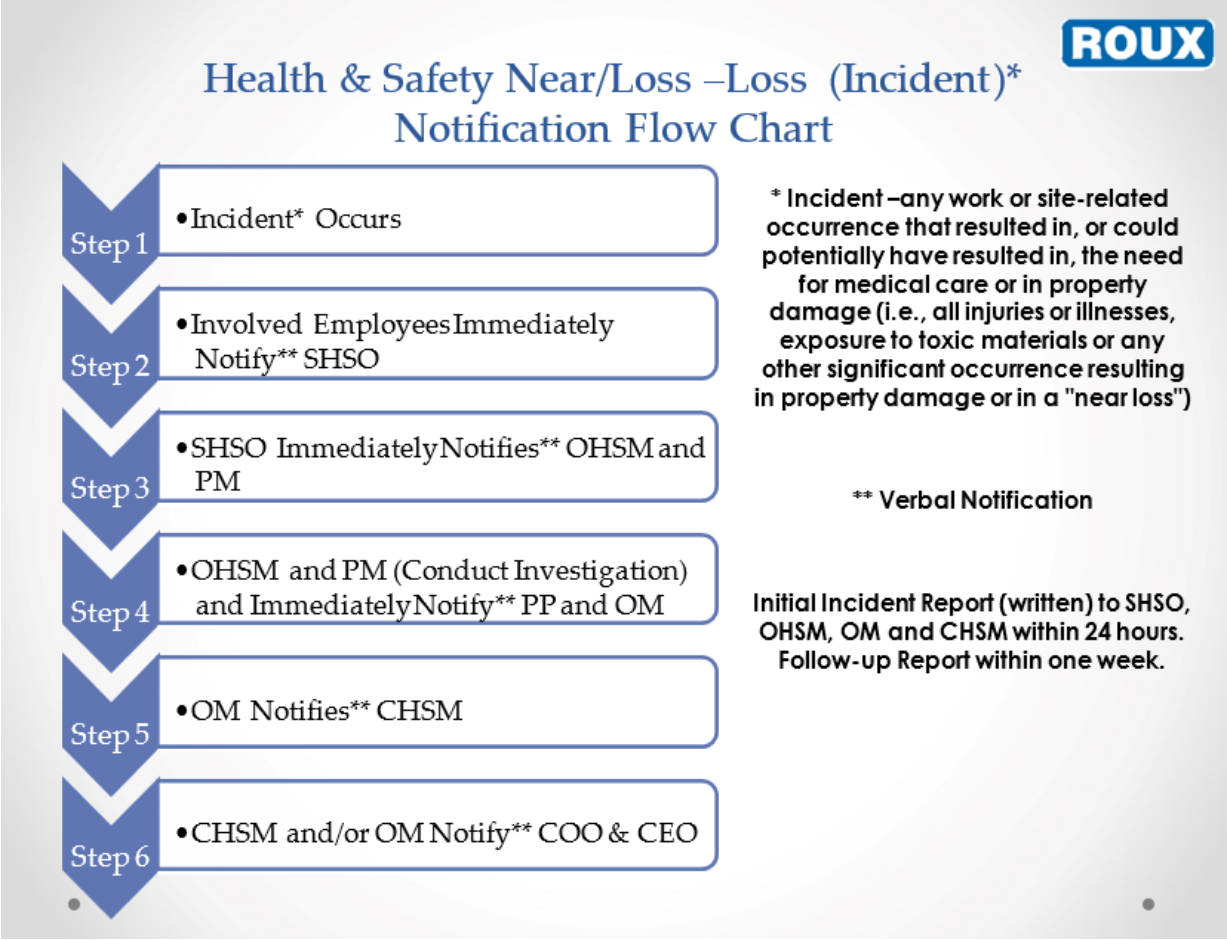

6.4 Adverse Weather Conditions

In the event of adverse weather conditions, the SHSO or project principal will determine if work can continue without sacrificing the health and safety of all field workers. Some of the items to be considered prior to determining if work should continue are:

- Potential for heat stress and heat-related injuries;
- Potential for cold stress and cold-related injuries;

- Treacherous weather-related conditions;
- Limited visibility; and
- Electrical storm potential.

Site activities will be limited to daylight hours and acceptable weather conditions. Inclement working conditions include heavy rain, fog, high winds, and lightning. Observe daily weather reports and evacuate if necessary in case of inclement weather conditions.

6.5 Electrical Storm Guidelines

In the event that lightning and/or thunder are observed while working onsite, all onsite activities shall stop and personnel shall seek proper shelter (e.g., substantial building, enclosed vehicle, etc.). Work shall not resume until the threat of lighting has subsided and no lightning or thunder has been observed for 30 minutes. If the possibility of lightning is forecast for the day, advise the onsite personnel on the risks and proper procedure at the pre-work safety briefing. Continuously monitor for changing weather conditions and allow enough time to properly stop work if lightning is forecast.

7. Safety Procedures

This section of the HASP presents the specific safety procedures to be implemented during Roux's activities at the Site in order to protect the health and safety of various on-site personnel. Minimum OSHA-mandated procedures are presented first, followed by client- and Site-specific procedures. Lastly, activity-specific procedures are discussed. These Site and activity-specific procedures supplement the general safety procedures included in Roux's Corporate Health and Safety Manual, which also must be followed in their entirely.

7.1 Training

At a minimum, Site personnel who will perform work in areas where there exists the potential for toxic exposure will be health and safety-trained prior to performing work onsite per OSHA 29 CFR 1910.120(e) and 29 CFR 1926.65(e). More specifically, all Roux, subcontractor, and other personnel engaged in sampling and remedial activities at the Site and who are exposed or potentially exposed to hazardous substances, health hazards, or safety hazards must have received at a minimum the 40 hour initial HAZWOPER training consistent with the requirements of 29CFR 1910.120(e)(3)(if) training and a minimum of 3 days' actual field experience under the direct supervision of a trained experienced supervisor, plus 8 hours of refresher training on an annual basis. Depending on tasks performed, less training may be permitted. Evidence of such training must be maintained at the Site at all times. Furthermore, all on-Site management and supervisory personnel directly responsible for or who supervise the employees engaged in Site remedial operations, must have received an additional 8 hours of specialized training at the time of job assignment on topics including, but not limited to, the employer's safety and health program and the associated employee training program, personal protective equipment program, spill containment program, and health hazard monitoring procedure and techniques, plus 8 hours of refresher training on an annual basis.

Roux personnel training records are maintained in a corporate database with records available upon request from either the OHSM/SHSO/CHSM or Human Resources Department.

7.2 Site-Specific Safety Briefings for Visitors

A site-specific briefing is provided to all site visitors who enter this site beyond the site entry point. For visitors, the site-specific briefing provides information about site hazards, the site lay-out including work zones and places of refuge, the emergency alarm system and emergency evacuation procedures, and other pertinent safety and health requirements as appropriate.

7.3 HASP Information and Site-Specific Briefings for Workers

Site personnel review this HASP and are provided a Site-specific tailgate briefing prior to the commencement of work to ensure employees are familiar with this HASP and the information and requirements it contains, as well as the relevant JSAs included in **Appendix A**. Additional briefings are provided as necessary to notify employees of any changes to this HASP as a result of information gathered during on-going Site characterization and analysis of changing conditions. Conditions for which we schedule additional briefings include, but are not limited to: changes in site conditions, changes in the work schedule/plan, newly discovered hazards, and incidents occurring during Site work.

7.4 Medical Surveillance

The medical surveillance section of the Health and Safety Plan describes how worker health status is monitored at this site. Medical surveillance is used when there is the potential for worker exposure to hazardous substance at levels above OSHA permissible exposure limits or other published limits. The purpose of a medical surveillance program is to medically monitor worker health to ensure that personnel are not adversely affected by site hazards. The provisions for medical surveillance at this site are based on the site characterization and job hazard analysis found in Section 4 of this HASP and are consistent with OSHA requirements in 29 CFR 1910.120(f) as applicable.

7.4.1 Site Medical Surveillance Program

Medical surveillance requirements are based on a worker's potential for exposure as determined by the site characterization and job hazard analysis documented in Section 4 and JSAs within **Appendix A** of this HASP and in compliance with the requirements of 29 CFR 1910.120(f)(2). Based on site information and use of direct reading instruments, limited use of respirators (less than 30 days per year), and the absence of an employee-staffed HAZMAT team, a limited medical surveillance program is required and implemented at this site. The medical surveillance program provides that:

1. Workers assigned to tasks requiring the use of respirators receive medical examinations in accordance with 29 CFR 1910.134(e) to ensure they are physically capable to perform the work and use the equipment, and
2. If a worker is injured, becomes ill, or develops signs or symptoms of possible over-exposure to hazardous substance or health hazards, medical examinations are provided to that worker as soon as possible after the occurrence and as required by the attending physician.
3. These medical examinations and procedures are performed by or under the supervision of a licensed physician and are provided to workers free of cost, without loss of pay, and at a reasonable time and place. In addition, the need to implement a more comprehensive medical surveillance program will be re-evaluated after any apparent over-exposure.

7.4.2 Medical Recordkeeping Procedures

Medical recordkeeping procedures are consistent with the requirements of 29 CFR 1910.1020 and are described in the company's overall safety and health program. A copy of that program is available at our Islandia, New York office.

The following items are maintained in worker medical records:

- Respirator fit test and selection;
- Physician's medical opinion of fitness for duty (pre-placement, periodic, termination);
- Physician's medical opinion of fitness for respirator protection (pre-placement, periodic); and
- Exposure monitoring results.

7.4.3 Program Review

The medical program is reviewed to ensure its effectiveness. The Corporate Health and Safety Manager in coordination with the Human Resources Director is responsible for this review. At minimum, this review consists of:

- Review of accident and injury records and medical records to determine whether the causes of accidents and illness were promptly investigated and whether corrective measures were taken wherever possible;

- Evaluation of the appropriateness of required medical tests based on site exposures; and
- Review of emergency treatment procedures and emergency contacts list to ensure they were site-specific, effective, and current.

7.5 Personnel Protection

Site safety and health hazards are eliminated or reduced to the greatest extent possible through engineering controls and work practices. Where hazards are still present, a combination of engineering controls, work practices and PPE are used to protect employees. Appropriate personal protective equipment (PPE) shall be worn by Site personnel when there is a potential exposure to chemical hazards or physical hazards (e.g., falling objects, flying particles, sharp edges, electricity, and noise), as determined by the SHSO. The level of personal protection, type and kind of equipment selected will depend on the hazardous conditions and in some cases cost, availability, compatibility with other equipment, and performance. An accurate assessment of all these factors will be made before work can be safely executed.

Roux maintains a comprehensive written PPE program that addresses proper PPE selection, use, maintenance, storage, fit and inspection. Roux's PPE program can be found within **Appendix D**. PPE to be used at the Site will meet the appropriate American National Standards Institute (ANSI) standards and the following OSHA (General/Construction Industry) standards for minimum PPE requirements.

The minimum level of PPE for entry onto the Site is Level D. The following equipment shall be worn:

- Work uniform (long pants, sleeved shirt);
- Hard hat;
- Steel or composite toe work boots;
- Safety Glasses (must comply with one of the following ANSI/ISEA Z87.1-2010, ANSI Z87.1-2003, ANSI Z87.1-2003);
- Boot Covers (as needed);
- Hearing protection (as needed);
- High visibility clothing (shirt/vest); and
- Hand protection (e.g., minimum cut resistance meeting ANSI 105-2000 Level 2).

Note that jewelry shall be removed or appropriately secured to prevent it from becoming caught in rotating equipment or unexpectedly snagged on a fixed object (e.g., wrist watches, bracelets, rings, chains and necklaces, open earrings). Do not wear loose clothing and all shoulder-length hair should be tied back.

Site specific PPE ensembles and materials are identified within task specific JSAs located within **Appendix A**, and any upgrades or downgrades of the level of protection (i.e., not specified in the JSA) must be approved by the PP and immediately communicated to all Roux personnel and subcontractors as applicable. PPE is used in accordance with manufacturer's recommendations.

7.5.1 Hearing Conservation

Hearing protection is made available when noise exposures equal or exceed an 8-hour time-weighted average sound level of 85 dBA. Hearing protection is required when the 8-hour time weighted average sound

level ≥ 90 dBA. Where noise exposure meets or exceeds this level, noise is listed as a physical hazard in the JSA for the tasks/operation, and hearing protection is included as one of the control measures (PPE).

7.6 Monitoring

An air monitoring program is important to the safety of on- and off-Site personnel, and the surrounding area. A preliminary survey, to establish background conditions in the immediate sampling area, may be made prior to the initiation of Site work including, but not limited to, monitoring wind direction (e.g., wind socks) and approximate temperature during all invasive Site activities. This survey will be conducted with the appropriate pre-calibrated air monitoring instrument(s), as warranted by the field activity. Once this survey has been complete, any changes in the type of PPE will be determined and relayed to those working on-Site.

Work zone air monitoring will be performed to verify that the proper level of PPE is used, and to determine if increased protection or work stoppage is required. The following equipment shall be used to monitor conditions:

- A Photoionization Detector (PID) with a lamp energy of 10.6 eV will be used to provide direct readings of organic vapor concentrations during intrusive activities to determine that personnel protection is adequate. Concentrations shall be recorded during intrusive activities with the potential to encounter contaminant vapors.
- Colorimetric detection tubes shall be used based on PID action levels to qualitatively identify possible contaminants as applicable.
- A pre-calibrated multi-gas meter with combustible Lower Explosive Limit (LEL), oxygen (O_2), carbon monoxide (CO), and hydrogen sulfide (H_2S) sensors shall be used to monitor the potential for oxygen-deficient atmospheres, explosive concentrations of organic vapors, and toxic gases during intrusive operations. Monitoring will be performed according to the action levels for oxygen and combustible gases provided in this section. The calibration for this device will be performed using a known gas composition calibration mixture.

Personal exposure monitoring utilizing activated charcoal tubes may be considered based on whether or not the area sample results are at or above half of the PEL. The decision to perform the monitoring will be made by, and under the control of, the CHSM.

Below are monitoring action levels for Site-specific chemicals of concern. In the event PID readings above the thresholds identified below are sustained for 5 minutes in the breathing zone, worker protection will require upgrading following notification to the OHSM and applicable parties (e.g., client, board of health, regulators, etc.).

7.6.1 Action Levels for Air Monitoring

PPE can remain at Level D if breathing zone VOC concentrations are less than 5 ppm and benzene is non-detect. Personnel are required to evacuate the Site when breathing zone VOC readings exceed 25 ppm.

The following tables include summaries of the air monitoring, work practices, and action levels for the expected contaminants. The action levels to initiate testing with colorimetric tubes for airborne volatiles is 1 ppm (PID reading) and is based on the Permissible Exposure Limit (PEL) for benzene (1 ppm). The colorimetric tubes are used to confirm the presence or absence of specific constituents, and they do not provide a measured concentration.

Air Monitoring Summary and Action Levels Organic Vapors	
PID Reading in Breathing Zone (ppm)[1]	**Action**
0-1 ppm above background[2]	Continue monitoring
1-5 ppm sustained 60 seconds	Continue monitoring, if applicable initiate additional collection of benzene using colorimetric tubes.
<5 ppm and no presence of benzene	Continue Monitoring, ventilate space
≥ 5 ppm - ≤ 25 ppm and no presence of benzene	Ventilate space until PID reads < 5 ppm. If < 5 ppm cannot be achieved, upgrade to Level C[3].
≥ 25 ppm	Ventilate space and evacuate area.

1 Based on relative response/sensitivity of PID to benzene.
2 Background concentrations should be established at the beginning of each work day. It may be necessary to re-establish background concentrations and ambient conditions vary through the day.
3 Measured air concentrations of known organic vapors will be reduced by the respirator to one half of the PEL or lower, and the individual and combined compound concentrations shall be within the service limit of the respirator cartridge.

Air Monitoring Summary and Action Levels Oxygen	
O_2 Reading in Breathing Zone (%)[1]	**Action**
20.9% O_2	Oxygen level normal
< 19.5% O_2	Oxygen deficient Interrupt task/Evacuate area
>23.5% O_2	Oxygen enriched Interrupt task/Evacuate area

1. Action levels based on USEPA Standard Operating Safety Guides; Table 5-1, Atmospheric Hazard Action Guidelines may be further restricted based on the CHSM's professional judgment and experience.

Air Monitoring Summary and Action Levels Carbon Monoxide	
CO Reading in Breathing Zone (ppm)[1]	**Action**
<25 ppm	Inspect exhaust system for leaks or other sources of CO. Monitor initially and every 15 minutes during use of CO-generating equipment.
25-50 ppm	Ventilate area. Monitor continuously and record measurements. Contact PM.
>50 ppm	Cease Field Operations. Ventilate area.

1. Based upon the American Conference of Governmental Industrial Hygienists (ACGIH) Threshold Limit Value (TLV) of 25 ppm as an 8-hour time weighted average (TWA) and OSHA's Permissible Exposure Limit (PEL) of 50 ppm as an 8-hour TWA concentration.

Air Monitoring Summary and Action Levels Combustible Gases	
Lower Explosive Limit (LEL) Reading	**Action**
< 4% LEL (<2,000 ppm)	Site activities will continue with normal monitoring
4% – 20% LEL (2,000 – 10,000 ppm)	Stop work until levels dissipate to <4% LEL
> 20% LEL (>10,000 ppm)	Potential explosion hazard. Halt all site activities, research source of release, aerate work area, suppress source.

Air Monitoring Summary and Action Levels Hydrogen Sulfide	
Hydrogen Sulfide (H_2S) Reading	**Action**
<10 ppm	Site activities will continue with normal monitoring
>10 ppm	Stop work until levels dissipate to <10 ppm; use mechanical ventilation if possible
Cannot use air purifying respirators for H_2S because of olfactory fatigue	

7.6.2 Air Monitoring Equipment and Calibration

A PID calibrated to an appropriate calibration mixture will be used to detect organic vapors in and around the work areas. Monitoring will be conducted in and around all work areas and at the workers breathing zone before activities commence to establish a background level, then at 15-minute intervals throughout the day. All equipment will be calibrated according to the manufacturer's recommendation. A calibration log will be maintained and will include the name of the person who performed the calibration, the date and time calibrated, and the instrument reading at the time of calibration. A manual bellows pump or equivalent with colorimetric tubes for formaldehyde will be utilized to determine the course of action related to upgrading or downgrading the level of respiratory protection, as applicable.

If air monitoring data indicate safe levels of potentially harmful constituents at consistent intervals (5-minute intervals), then monitoring can be conducted less frequently (every 30 minutes). This determination will be made by the onsite SHSO. Monitoring data, including background readings and calibration records, will be documented. Work to be performed on-Site will conform to Roux's Standard Operating Procedures (SOPs). Conformance with these guidelines as well as the guidelines described in this HASP will aid in mitigating the physical and chemical hazards mentioned throughout this HASP.

7.7 Tailgate Safety Meetings

A designated Site worker will provide daily safety briefings (e.g., tailgate meetings) including, but not limited to, the following scenarios:

- When new operations are to be conducted;
- Whenever changes in work practices must be implemented; and

- When new conditions are identified and/or information becomes available.

Daily safety briefings shall be recorded on the Roux Daily Tailgate Health and Safety Meeting Log/Daily Site Safety Checklist, and all completed forms will become a part of the project file.

7.8 Spill Containment

Spill containment equipment and procedures should, at a minimum, meet the requirements of the facility's Spill Prevention, Control and Countermeasure Plan, if applicable. Otherwise, spill containment equipment and procedures must be considered depending on the task including, but no limited to, chemical/product transfer points and handling.

7.8.1 Initial Spill Notification and Response

Any worker who discovers a hazardous substance spill will immediately notify Brandon Vella, Project Manager. The worker will, to his/her best ability, report the hazardous substance involved, the location of the spill, the estimated quantity of material spilled, the direction/flow of the spill material, related fire/explosion incidents, and any associated injuries without compromising their own safety.

7.8.2 Spill Evaluation and Response

Brandon Vella, Project Manager, is responsible for evaluating spills and determining the appropriate response. When this evaluation is being made, the spill area will be isolated and demarcated to the extent possible. If necessary to protect nearby community members, notification of the appropriate authorities is made by the PM as appropriate. On-Site response is limited to small spills (e.g., <10 gallons); large spills require external emergency responders who will be contacted by the SHSO.

7.9 Decontamination

The decontamination section of the HASP describes how personnel and equipment are decontaminated when they leave the Exclusion Zone. This section also describes how residual waste from decontamination processes is disposed. The site decontamination procedures are designed to achieve an orderly, controlled removal or neutralization of contaminants that may accumulate on personnel or equipment. These procedures minimize worker contact with contaminants and protect against the transfer of contaminants to clean areas of the site and off-site. They also extend the useful life of PPE by reducing the amount of time that contaminants contact and can permeate PPE surfaces. Decontamination is facilitated within the CRZ at this site, if applicable.

7.9.1 Decontamination Procedures for Personnel and PPE

The following are general decontamination procedures established and implemented at this site.

1. Decontamination is required for all workers exiting a contaminated area. Personnel may re-enter the SZ only after undergoing the decontamination procedures described below in the next section.
2. Protective clothing is decontaminated, cleaned, laundered, maintained and/or replaced as needed to ensure its effectiveness.
3. PPE used at this site that requires maintenance or parts replacement is decontaminated prior to repairs, or

4. PPE used at this site is decontaminated or prepared for disposal on the premises. Personnel who handle contaminated equipment have been trained in the proper means to do so to avoid hazardous exposure.
5. This site uses an off-site laundry for decontamination of PPE. The site has informed that facility of the hazards associated with contaminated PPE from this site.
6. The site requires and trains workers that if their permeable clothing is splashed or becomes wetted with a hazardous substance, they will immediately exit the work zone, perform applicable decontamination procedures, shower, and change into uncontaminated clothing.
7. Procedures for disposal of decontamination waste meet applicable local, State, and Federal regulations.

7.9.2 Decontamination Procedures for Equipment

All tools, equipment, and machinery from the EZ or CRZ are decontaminated in the CRZ prior to removal to the SZ. Equipment decontamination procedures are designed to minimize the potential for hazardous skin or inhalation exposure and to avoid cross-contamination and chemical incompatibilities.

General Equipment Decontamination Procedures:

1. Decontamination is required for all equipment exiting a contaminated area. Equipment may re-enter the SZ only after undergoing the equipment decontamination procedures.
2. Vehicles that travel regularly between the contaminated and clean areas of the site are carefully decontaminated each time they exit the EZ and the effectiveness of that decontamination is monitored to reduce the likelihood that contamination will be spread to other parts of the site.
3. Particular attention is given to decontaminating tires, scoops, and other parts of heavy equipment that are directly exposed to contaminants and contaminated soil.

The following items may be used to decontaminate equipment:

- Fresh water rinse;
- Non-phosphorus detergent wash;
- Distilled water rinse;
- Acetone rinse;
- Distilled water rinse; and
- A steam cleaner or pressure washer (heavy equipment only).

7.9.3 Monitoring the Effectiveness of Decontamination Procedures

Visual examination and sampling are used to evaluate the effectiveness of decontamination procedures. Visual examination is used to ensure that procedures are implemented as described and that they appear to control the spread of contaminants under changing site conditions. Visual examination is also used to inspect for signs of residual contamination or for contaminant permeation of PPE.

Personnel who work in contaminated areas of the site, either the Contamination Reduction Zone (CRZ) or the Exclusion Zone, are trained in the principles and practices of decontamination described in this section of the HASP and in related SOPs. If site procedures are changed as a result of inspection and monitoring, all affected employees are notified of these changes.

7.10 Confined Space Entry

The following is a list of the safety requirements for confined space entry at the Site:

- **ROUX PERSONNEL ARE NOT AUTHORIZED TO ENTER AN OSHA PERMIT REQUIRED CONFINED SPACE;**
- Currently the scope of work **DOES NOT** require personnel to enter permitted confined space for this project; and
- Any changes to the field activities that may necessitate confined space entry will be reported to the Project Principal and OHSM.

Confined space is defined as any space, depression, or enclosure that:

- Has limited opening for entry and egress;
- Is large enough for and employee to enter and perform assigned work; and
- Is not intended for continuous occupancy.

A permit required confined space is one that meets the definition of a confined space and has one or more of the following characteristics:

- May contain or produce life-threatening atmospheres due to oxygen deficiency the presence of toxic, flammable, or corrosive contaminants;
- Contains a material that has the potential for engulfment;
- Has an internal configuration that may cause an entrant to be trapped or asphyxiated by inwardly converging walls or by a floor that slopes downward and tapers to a smaller cross-section; and
- Contains any other serious safety or health hazards.

Although Roux personnel will not perform confined space entry, it is expected that subcontractors performing cleaning and mitigation and/or remedial measures activities may be required to enter structures that are considered to be a permit required confined space. Permitting of the confined space as well as hazard mitigation for entry will be completed by the subcontractor in accordance with 1910.146.

7.11 Client and Site-Specific

In addition to the OSHA-specific procedures discussed above, there may be client and site-specific safety procedures that must be adhered to during the performance of remedial activities at the Site. Any client and site-specific requirements will be documented and brought to the attention of Roux and Roux subcontractor personnel.

7.12 Unusual or Significant Risks

Field activities that appear to have unusual or significant risks that cannot be adequately managed with existing risk tools such as LPS, HASPs, traffic safety plans, work permits, design and O&M practices, equipment HAZOPS or other safety tools must be referred to the CHSM to help with the assessment and management of the associated potential safety risks. Examples include the use of explosives for demolition, use of firearms to control wildlife, rappelling, demolition over water, diving, etc.

7.13 Activity-Specific Hazards

In addition to the general hazards discussed above, there are activity-specific hazards associated with each work activity planned for the Site. An activity-specific JSA has been completed for each of the activities planned for the Site. JSAs are provided in **Appendix A**. In the event that new work activities or tasks are planned, JSAs will be developed and implemented prior to performing the new activities. In the absence of a JSA, the personnel performing work must prepare a field JSA and receive clearance from a designated competent safety official prior to performing any task with significant risk. In emergency situations where time is critical SPSAs will be utilized to identify the task, associated hazards and mitigative actions to take. For lower risk activities (as deemed by the discretion of a Competent Person) where a JSA is determined to not be needed, the individual(s) conducting the activities must perform SPSAs prior to and during the work.

7.13.1 Electrical and Other Utility Assessment and Accommodations

Roux shall perform a site walk to identify any potential overhead electrical or utility lines. All applicable guidelines will be followed in the vicinity of overhead power and utility lines (see Section 7.13.3 below).

Prior to commencing work, Roux will review all available Site maps showing buried utility lines to identify potential hazards to confirm no underground hazards are known to exist in the vicinity of the areas of the Site pertinent to this HASP. Roux or its subcontractor(s) will complete a “one-call” public utility mark out. Additionally, a private utility mark-out and/or geophysical investigation may be performed. The results of all utility assessments will be available on-Site for review during implementation of all scopes of work involving intrusive activities.

7.13.2 Subsurface Work

Subsurface work activities will require adherence to Roux’s Corporate Subsurface Utility Clearance Management program found within **Appendix E**.

7.13.2.1 Excavations and Trenching

All trenching and excavation work activities contracted by Roux shall comply with 29 CFR 1926.651-652 Subpart P. Additionally, for trenches greater than 4 feet deep, where employees will enter, the trench needs to have a stairway or ladder or other safe means of egress. Where employees will enter trenches greater than 5 feet deep, the trench must have some type of protective system or sloped appropriately to prevent cave-ins.

The SHSO will be present on-Site during all Roux contracted excavation and backfill operations and will supplement health and safety monitoring conducted by Subcontractor air quality screening to ensure that appropriate levels of protection and safety procedures are utilized. The proximity of chemical, water, sewer, and electrical lines will be identified by Roux and/or their subcontractor before any subsurface activity or sampling is attempted.

The following safe work practices will be implemented during this task.

- The proximity of chemical, water, sewer, and electrical lines will be identified by a facility representative prior to beginning any subsurface activity.
- While earthmoving, stay out of the excavator’s delineated heavy equipment exclusion zone and away from the excavation sides, where there is potential for cave in (within excavations that are 6 feet or more in depth, a delineated perimeter 6 feet away from the excavated edge is required).

Maximum Allowable Slopes

Soil or Rock Type	Maximum Allowable Slopes (H:V)[1] for Excavations Less Than 20 Feet Deep[3]
Stable Rock	Vertical (90°)
Type A[2]	3/4 : 1 (53°)
Type B	1 : 1 (45°)
Type C	1 1/2 : 1 (34°)

OSHA (29 CFR 1926.652, Subpart P, Appendices A and B)

Notes:

1 Numbers shown in parentheses next to maximum allowable slopes are angles expressed in degrees from the horizontal. Angles have been rounded off.

2 A short-term maximum allowable slope of 1/2H : 1V (63°) is allowed in excavations in Type A soil that are 12 feet (3.67 meters) or less in depth. Short-term maximum allowable slopes for excavations greater than 12 feet (3.67 meters) in depth shall be 3/4H : 1V (53°).

3 Sloping or benching for excavations greater than 20 feet deep shall be designed and stamped by a registered professional engineer.

Proper stockpiling (i.e., 2 feet minimum distance from the excavation edge), containment, transport, storage, and disposal practices will be utilized and is dependent upon the potential type and amount of waste generated during operations. The location of safety equipment and evacuation procedures will be established prior to initiation of operations according to this HASP.

7.13.3 Heavy Equipment

Use of heavy equipment at the Site will require adherence to Roux's Corporate Heavy Equipment Exclusion Zone Management Program found within **Appendix F**. Additionally, operation of the drill rig/other heavy equipment will maintain clearances from overhead power lines in accordance with OSHA 29 CFR1926.1408 Table A Minimum Clearance Distances provided below.

Minimum Required Clearances for Energized Overhead Power Lines

Nominal System Voltage of Power Line (K V)	Minimum Required Clearance (feet)
0-50	10
51-100	12
101-200	15
201-300	20
301-500	25
501-750	35
751-1000	45

1 kilovolt (KV) = 1,000 volts

7.14 Heat Stress

The National Oceanic and Atmospheric Administration records average minimum/maximum temperatures of 48 to 62 degrees Fahrenheit during the year in Brooklyn, New York.

7.14.1 Heat Stress

Heat stress is a significant potential hazard and can be associated with heavy physical activity and/or the use of personal protective equipment in hot weather environments. Heat cramps are brought on by prolonged exposure to heat. As an individual sweats, water and salts are lost by the body resulting in painful muscle cramps. The signs and symptoms of heat stress are as follows:

- Severe muscle cramps, usually in the legs and abdomen;
- Exhaustion, often to the point of collapse; and
- Dizziness or periods of faintness.

First aid treatment includes, but is not limited to, shade, rest, and fluid replacement. Typically, the individual should recover within one-half hour while being monitored constantly. If the individual has not improved substantially within 30 minutes and the body temperature has not decreased, the individual should be transported to a hospital for medical attention.

7.14.2 Heat Exhaustion

Heat exhaustion may occur in a healthy individual who has been exposed to excessive heat while working or exercising. The circulatory system of the individual fails as blood collects near the skin to rid the body of excess heat through transference. The signs and symptoms of heat exhaustion are as follows:

- Rapid and shallow breathing;
- Weak pulse;
- Cold and clammy skin with heavy perspiration;
- Skin appears pale;
- Fatigue and weakness;
- Dizziness; and
- Elevated body temperature.

First aid treatment includes, but is not limited to, cooling the victim, elevating the feet, and replacing fluids.

If the individual is not substantially improved within 30 minutes and the body temperature has not decreased, the individual should be transported to the hospital for medical attention.

7.14.3 Heat Stroke

Heat stroke occurs when an individual is exposed to excessive heat and stops sweating. This condition is classified as a MEDICAL EMERGENCY requiring immediate cooling of the victim and transport to a medical facility. The signs and symptoms of heat stroke are as follows:

- Dry, hot red skin;
- Body temperature approaching or above 105 degrees F;
- Confusion, altered mental state, slurred speech;
- Seizures;
- Large (dilated) pupils; and

- Loss of consciousness – the individual may go into a coma.

First aid treatment requires immediate cooling and transportation to a medical facility. Heat stress is a significant hazard if any type of protective equipment (semi-permeable or impermeable) that prevents evaporative cooling when worn in hot weather environments.

7.15 Cold Stress

Cold stress is a danger at low temperatures and when the wind-chill factor is low. Prevention of cold-related illnesses is a function of whole-body protection. Adequate insulating clothing must be used when the air temperature is below 60°F. A work/rest regimen will be initiated when ambient temperatures and protective clothing cause a stressful situation. In addition, reduced work periods followed by rest in a warm area may be necessary in extreme conditions. The signs and symptoms of cold stress include the following:

- Severe shivering;
- Abnormal behavior;
- Slowing;
- Weakness;
- Stumbling or repeated falling;
- Inability to walk;
- Collapse; and/or
- Unconsciousness.

First aid requires removing the victim from the cold environment and seeking medical attention immediately. Also, prevent further body heat loss by covering the victim lightly with blankets. Do not cover the victim's face. If the victim is still conscious, administer hot drinks and encourage activity such as walking, wrapped in a blanket.

8. Field Team Review

Each person performing work at or visiting this site shall sign this section after site-specific training is completed and before being permitted to access the CRZ or Exclusion Zone.

I have read and understand this Site-Specific Health and Safety Plan. I will comply with the provision contained therein.

Site/Project: Broadway Triangle Site C

Name & Company	Signature	Date

9. Approvals

By their signature, the undersigned certify that this HASP is approved and will be utilized at the Broadway Triangle Site C project Site.

Emily Butler – Site Health and Safety Officer	July 30, 2021 Date
Kristina DeLuca – Office Health and Safety Manager	July 30, 2021 Date
Brandon Vella – Project Manager	July 30, 2021 Date
Jessica L. Taylor, P.G. – Project Principal	July 30, 2021 Date

TABLE

Toxicological Properties of Hazardous Substances
Present at the Site

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at the Site

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
VOLATILE ORGANIC COMPOUNDS (VOCs)									
1,1,1-Trichloroethane	71-55-6	TWA 350 ppm STEL 450 ppm	C 350 ppm (1900 mg/m^3) [15-minute]	TWA 350 ppm (1900 mg/m^3)	700 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin; headache, lassitude (weakness, exhaustion), central nervous system depression, poor equilibrium; dermatitis; cardiac arrhythmias; liver damage	Eyes, skin, central nervous system, cardiovascular system, liver	Colorless liquid with a mild, chloroform-like odor. BP: 165°F Fl.Pt. = NA LEL: 7.5% UEL: 12.5% Combustible Liquid, but burns with difficulty
1,1,2,2-Tetrachloroethane	79-34-5	TWA 1 ppm	Ca TWA 1 ppm (7 mg/m^3)	TWA 5 ppm (35 mg/m^3)	Ca [100 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Nausea, vomiting, abdominal pain; tremor fingers; jaundice, hepatitis, liver tenderness; dermatitis; leukocytosis (increased blood leukocytes); kidney damage; [potential occupational carcinogen]	Skin, liver, kidneys, central nervous system, gastrointestinal tract	Colorless to pale-yellow liquid with a pungent, chloroform-like odor BP: 296°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Liquid
1,1,2-Trichloro-1,2,2-trifluoroethane	76-13-1	TWA 1000 ppm STEL 1250 ppm	TWA 1000 ppm (7600 mg/m3) ST 1250 ppm (9500 mg/m3)	TWA 1000 ppm (7600 mg/m3)	2000 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation skin, throat, drowsiness, dermatitis; central nervous system depression; In Animals: cardiac arrhythmias, narcosis	Skin, heart, central nervous system, cardiovascular system	Colorless to water-white liquid with an odor like carbon tetrachloride at high concentrations. [Note: A gas above 118°F.] BP: 118°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Liquid at ordinary temperatures, but the gas will ignite and burn weakly at 1256°F.
1,1,2-Trichloroethane	79-00-5	TWA 10 ppm	Ca TWA 10 ppm (45 mg/m3) [skin]	TWA 10 ppm (45 mg/m3)	Ca [100 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, nose; central nervous system depression; liver, kidney damage; dermatitis; [potential occupational carcinogen]	Eyes, respiratory system, central nervous system, liver, kidneys	Colorless liquid with a sweet, chloroform-like odor BP: 237°F Fl.Pt. = NA LEL: 6% UEL: 15.5% Combustible Liquid, forms dense soot
1,1-Dichloroethane	75-34-3	TWA 100 ppm	TWA 100 ppm (400 mg/m^3)	TWA 100 ppm (400 mg/m^3)	3,000 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation skin; central nervous system depression; liver, kidney, lung damage	Skin, liver, kidneys, lungs, central nervous system	Colorless, oily liquid with a chloroform-like odor. BP: 135°F Fl.Pt. = 2°F LEL: 5.4% UEL: 11.4% Class IB Flammable Liquid Fl.P. below 73°F and BP at or above 100°F.
1,1-Dichloroethene	75-35-4	TWA 5 ppm	Ca	None	Ca	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, throat; dizziness, headache, nausea, dyspnea (breathing difficulty); liver, kidney disturbance; pneumonitis; [potential occupational carcinogen]	Eyes, skin, respiratory system, central nervous system, liver, kidneys	Colorless liquid or gas (above 89°F) with a mild, sweet, chloroform-like odor BP: 89°F Fl.Pt. = -2°F LEL: 6.5% UEL: 15.5% Class IA Flammable Liquid: Fl.P. below 73°F and BP below 100°F
1,2,3-Trichlorobenzene	87-61-6	Cameo Chemicals Source https://cameochemicals.noaa.gov/chemical/10051				Inhalation, skin absorption, ingestion, skin and/or eye contact	Inhalation may cause irritation of respiratory tract. Irritating to the eyes. May redden skin on contact. Ingestion may cause liver damage.	Skin, eyes, respiratory tract, liver	A white solid with a sharp chlorobenzene odor. Insoluble in water and denser than water. Hence sinks in water Fl.Pt. = 234.9°F
1,2,4-Trichlorobenzene	120-82-1	STEL C 5 ppm	C 5 ppm (40 mg/m3)	None	N.D.	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation eyes, skin, mucous membrane; In Animals: liver, kidney damage; possible teratogenic effects	Eyes, skin, respiratory system, liver, reproductive system	Colorless liquid or crystalline solid (below 63°F) with an aromatic odor BP: 416°F Fl.Pt. = 222°F LEL (302°F): 2.5% UEL (302°F): 6.6% Class IIIB Combustible Liquid: Fl.P. at or above 200°F. Combustible Solid

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at the Site

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
1,2-Dibromo-3-chloropropane	96-12-8		Ca	[1910.1044] TWA 0.001 ppm	Ca	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; drowsiness; nausea, vomiting; pulmonary edema; liver, kidney injury; sterility; [potential occupational carcinogen]	Eyes, skin, respiratory system, central nervous system, liver, kidneys, spleen, reproductive system, digestive system	Dense yellow or amber liquid with a pungent odor at high concentrations. [pesticide] [Note: A solid below 43°F.] BP: 384°F Fl.Pt. = (oc) 170°F LEL: NA UEL: NA Class IIIA Combustible Liquid: Fl.P. at or above 140°F and below 200°F.
1,2-Dibromoethane	106-93-4	None listed	Ca TWA 0.045 ppm C 0.13 ppm [15-minute]	TWA 20 ppm C 30 ppm 50 ppm [5-minute maximum peak]	Ca [100 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, respiratory system; dermatitis with vesiculation; liver, heart, spleen, kidney damage; reproductive effects; [potential occupational carcinogen]	Eyes, skin, respiratory system, liver, kidneys, reproductive system	Colorless liquid or solid (below 50°F) with a sweet odor. [fumigant] BP: 268°F Fl.Pt. = 50°F LEL: NA UEL: NA Noncombustible Liquid
1,2-Dichlorobenzene	95-50-1	TWA 25 ppm STEL 50 ppm	C 50 ppm (300 mg/m3)	C 50 ppm (300 mg/m3)	200 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, nose; liver, kidney damage; skin blisters	Eyes, skin, respiratory system, liver, kidneys	Colorless to pale-yellow liquid with a pleasant, aromatic odor. [herbicide] BP: 357°F Fl.Pt. = 1°F LEL: 2.2% UEL: 9.2% Class IIIA Combustible Liquid: Fl.P. at or above 140°F and below 200°F.
1,2-Dichloroethane	107-06-2	TWA 10 ppm	Ca TWA 1 ppm (4 mg/m3) ST 2 ppm (8 mg/m3)	TWA 50 ppm C 100 ppm 200 ppm [5-minute maximum peak in any 3 hours]	Ca [50 ppm]	Inhalation, ingestion, skin absorption, skin and/or eye contact	Irritation eyes, corneal opacity; central nervous system depression; nausea, vomiting; dermatitis; liver, kidney, cardiovascular system damage; [potential occupational carcinogen]	Eyes, skin, kidneys, liver, central nervous system, cardiovascular system	Colorless liquid with a pleasant, chloroform-like odor. [Note: Decomposes slowly, becomes acidic & darkens in color.] BP: 182°F Fl.Pt. = 56°F LEL: 6.2% UEL: 16% Class IB Flammable Liquid Fl.P. below 73°F and BP at or above 100°F.
1,2-Dichloropropane	78-87-5	TWA 10 ppm	Ca	TWA 75 ppm (350 mg/m3)	Ca [400 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, respiratory system; drowsiness, dizziness; liver, kidney damage; In Animals: central nervous system depression; [potential occupational carcinogen]	Eyes, skin, respiratory system, liver, kidneys, central nervous system	Colorless liquid with a chloroform-like odor. [pesticide] BP: 206°F Fl.Pt. = 60°F LEL: 3.4% UEL: 14.5% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F.
1,3-Dichlorobenzene	541-73-1	https://cameochemicals.noaa.gov/chemical/8514				Inhalation, skin absorption, ingestion, skin and/or eye contact	INHALATION: Causes headache, drousiness, unsteadiness. Irritating to mucous membranes. EYES: Severe irritation. SKIN: Severe irritation. INGESTION: Irritation of gastric mucosa, nausea, vomiting, diarrhea, abdominal cramps and cyanosis.		Colorless liquid. Sinks in water. BP: 343°F Fl.Pt. = 146°F LEL: 2.02% UEL: 9.2%
1,4-Dichlorobenzene	106-46-7	TWA 10 ppm	Ca	TWA 75 ppm (450 mg/m3)	Ca [150 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Eye irritation, swelling periorbital (situated around the eye); profuse rhinitis; headache, anorexia, nausea, vomiting; weight loss, jaundice, cirrhosis; In Animals: liver, kidney injury; [potential occupational carcinogen]	Liver, respiratory system, eyes, kidneys, skin	Colorless or white crystalline solid with a mothball-like odor. [insecticide] BP: 345°F Fl.Pt. = 150°F LEL: 2.5% UEL: NA Combustible Solid, but may take some effort to ignite.
1,4-Dioxane	123-91-1	TWA 20 ppm	Ca C 1 ppm (3.6 mg/m3) [30-minute]	TWA 100 ppm (360 mg/m3) [skin]	Ca [500 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	irritation eyes, skin, nose, throat; drowsiness, headache; nausea, vomiting; liver damage; kidney failure; [potential occupational carcinogen]	Eyes, skin, respiratory system, liver, kidneys	Colorless liquid or solid (below 53°F) with a mild, ether-like odor. BP: 214°F Fl.Pt. = 55°F LEL: 2.0% UEL: 22% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at the Site

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
2-Butanone	78-93-3	TWA 200 ppm STEL 300 ppm	TWA 200 ppm (590 mg/m3) ST 300 ppm (885 mg/m3)	TWA 200 ppm (590 mg/m3)	3000 ppm	inhalation, ingestion, skin and/or eye contact	irritation eyes, skin, nose; headache; dizziness; vomiting; dermatitis	Eyes, skin, respiratory system, central nervous system	Colorless liquid with a moderately sharp, fragrant, mint- or acetone-like odor BP: 175°F Fl.Pt. = 16°F LEL (200°F): 1.4% UEL (200°F): 11.4% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F
2-Hexanone	591-78-6	TWA 5 ppm STEL 10 ppm	TWA 1 ppm (4 mg/m3)	TWA 100 ppm (410 mg/m3)	1600 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, nose; peripheral neuropathy: lassitude (weakness, exhaustion), paresthesia; dermatitis; headache, drowsiness	Eyes, skin, respiratory system, central nervous system, peripheral nervous system	Colorless liquid with an acetone-like odor BP: 262°F Fl.Pt. = 77°F LEL: NA UEL: 8.0% Class IC Flammable Liquid: Fl.P. at or above 73°F and below 100°F
4-Methyl-2-pentanone	108-10-1	TWA 20 ppm STEL 75 ppm	TWA 50 ppm (205 mg/m3) ST 75 ppm (300 mg/m3)	TWA 100 ppm (410 mg/m3)	500 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, mucous membrane; headache, narcosis, coma; dermatitis; In Animals: liver, kidney damage	Eyes, skin, respiratory system, central nervous system, liver, kidneys	Colorless liquid with a pleasant odor BP: 242°F Fl.Pt. = 64°F LEL (200°F): 1.2% UEL (200°F): 8.0% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F
Acetone	67-64-1	TWA 250 ppm STEL 500 ppm	TWA 250 ppm (590 mg/m^3)	TWA 1000 ppm (2400 mg/m^3)	2500 ppm [10% LEL]	Inhalation, ingestion, skin and/or eye contact	irritation eyes, nose, throat; headache, dizziness, central nervous system depression; dermatitis	Eyes, skin, respiratory system, central nervous system	Colorless liquid with a fragrant, mint-like odor BP: 133°F Fl.Pt. = 0°F LEL: 12.8% UEL: 2.5% Class IB Flammable liquid: Fl.P. below 73°F and BP at or above 100°F.
Benzene	71-43-2	TWA 0.5 ppm STEL 2.5 ppm	Ca TWA 0.1 ppm ST 1 ppm	TWA 1 ppm ST 5 ppm	Ca [500 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, respiratory system; dizziness; headache, nausea, staggered gait; anorexia, lassitude (weakness, exhaustion); dermatitis; bone marrow depression; [potential occupational carcinogen]	Eyes, skin, respiratory system, blood, central nervous system, bone marrow	Colorless to light yellow liquid with an aromatic odor [Note: Solid below 42 °F] BP: 176°F Fl.Pt. = 12°F LEL: 1.2% UEL: 7.8% Class IB Flammable liquid. Fl.P. below 73°F and BP at or above 100°F.
Bromochloromethane	74-97-5	TWA 200 ppm	TWA 200 ppm (1050 mg/m3)	TWA 200 ppm (1050 mg/m3)	2000 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, throat; confusion, dizziness, central nervous system depression; pulmonary edema	Eyes, skin, respiratory system, liver, kidneys, central nervous system	Colorless to pale-yellow liquid with a chloroform-like odor. [Note: May be used as a fire extinguishing agent.] BP: 155°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Liquid
Bromodichloromethane	75-27-4	https://cameochemicals.noaa.gov/chemical/16064				Inhalation, ingestion, skin and/or eye contact	Symptoms of exposure to this compound may include irritation of the skin, eyes, mucous membranes and respiratory tract. It may also cause narcosis. Other symptoms may include nausea, dizziness and headache.	Liver and kidney damage. Central nervous system effects may also occur.	Clear colorless liquid BP: 189°F Fl.Pt. = NA LEL: NA UEL: NA
Bromoform	75-25-2	TWA 0.5 ppm	TWA 0.5 ppm (5 mg/m3) [skin]	TWA 0.5 ppm (5 mg/m3) [skin]	850 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, respiratory system; central nervous system depression; liver, kidney damage	Eyes, skin, respiratory system, central nervous system, liver, kidneys	Colorless to yellow liquid with a chloroform-like odor. [Note: A solid below 47°F.] BP: 301°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Liquid

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at the Site

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
Bromomethane	74-83-9	TWA 1 ppm	Ca	C 20 ppm (80 mg/m3) [skin]	Ca [250 ppm]	Inhalation, skin absorption (liquid), skin and/or eye contact (liquid)	Irritation eyes, skin, respiratory system; muscle weak, incoordination, visual disturbance, dizziness; nausea, vomiting, headache; malaise (vague feeling of discomfort); hand tremor; convulsions; dyspnea (breathing difficulty); skin vesiculation; liquid: frostbite; [potential occupational carcinogen]	Eyes, skin, respiratory system, central nervous system	Colorless gas with a chloroform-like odor at high concentrations. [Note: A liquid below 38°F. Shipped as a liquefied compressed gas.] BP: 38°F Fl.Pt. = NA (Gas) LEL: 10% UEL: 16.0% Flammable Gas, but only in presence of a high energy ignition source.
Carbon disulfide	75-15-0	TWA 1 ppm	TWA 1 ppm (3 mg/m3) ST 10 ppm (30 mg/m3) [skin]	TWA 20 ppm C 30 ppm 100 ppm (30-minute maximum peak)	500 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Dizziness, headache, poor sleep, lassitude (weakness, exhaustion), anxiety, anorexia, weight loss; psychosis; polyneuropathy; Parkinson-like syndrome; ocular changes; coronary heart disease; gastritis; kidney, liver injury; eye, skin burns; dermatitis; reproductive effects	Central nervous system, peripheral nervous system, cardiovascular system, eyes, kidneys, liver, skin, reproductive system	Colorless to faint-yellow liquid with a sweet ether-like odor. [Note: Reagent grades are foul smelling.] BP: 116°F Fl.Pt. = -22°F LEL: 1.3% UEL: 50.0% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F.
Carbon tetrachloride	56-23-5	TWA 5 ppm STEL 10 ppm	Ca ST 2 ppm (12.6 mg/m3) [60-minute]	TWA 10 ppm C 25 ppm 200 ppm (5-minute maximum peak in any 4 hours)	Ca [200 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin; central nervous system depression; nausea, vomiting; liver, kidney injury; drowsiness, dizziness, incoordination; [potential occupational carcinogen]	Central nervous system, eyes, lungs, liver, kidneys, skin	Colorless liquid with a characteristic ether-like odor BP: 170°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Liquid
Chlorobenzene	108-90-7	TWA 10 ppm	TWA 75 ppm	TWA 75 ppm (350 mg/m3)	1000 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, nose; drowsiness, incoordination; central nervous system depression; In Animals: liver, lung, kidney injury	Eyes, skin, respiratory system, central nervous system, liver	Colorless liquid with an almond-like odor BP: 270°F Fl.Pt. = 82°F LEL: 1.3% UEL: 9.6% Class IC Flammable Liquid: Fl.P. at or above 73°F and below 100°F.
Chloroethane	75-00-3	TWA 100 ppm	Handle with caution in the workplace	TWA 1000 ppm (2600 mg/m3)	3800 ppm [10%LEL]	Inhalation, skin absorption (liquid), ingestion (liquid), skin and/or eye contact	Incoordination, inebriation; abdominal cramps; cardiac arrhythmias, cardiac arrest; liver, kidney damage	Liver, kidneys, respiratory system, cardiovascular system, central nervous system	Colorless gas or liquid (below 54°F) with a pungent, ether-like odor. [Note: Shipped as a liquefied compressed gas.] BP: 54°F Fl.Pt. = NA (gas), -58°F (liquid) LEL: 3.8% UEL: 15.4% Flammable Gas
Chloroform	67-66-3	TWA 10 ppm	Ca ST 2 ppm (9.78 mg/m3) [60-minute]	C 50 ppm (240 mg/m3)	Ca [500 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin; dizziness, mental dullness, nausea, confusion; headache, lassitude (weakness, exhaustion); anesthesia; enlarged liver; [potential occupational carcinogen]	Liver, kidneys, heart, eyes, skin, central nervous system	Colorless liquid with a pleasant odor BP: 143°F Fl.Pt. = -82°F LEL: NA UEL: NA Noncombustible Liquid
Chloromethane	74-87-3	TWA 50 ppm STEL 100 ppm	Ca	TWA 100 ppm C 200 ppm 300 ppm (5-minute maximum peak in any 3 hours)	Ca [2000 ppm]	Inhalation, skin and/or eye contact (liquid)	Dizziness, nausea, vomiting; visual disturbance, stagger, slurred speech, convulsions, coma; liver, kidney damage; liquid: frostbite; reproductive, teratogenic effects; [potential occupational carcinogen]	Central nervous system, liver, kidneys, reproductive system	Colorless gas with a faint, sweet odor which is not noticeable at dangerous concentrations. [Note: Shipped as a liquefied compressed gas.] BP: -12°F Fl.Pt. = NA (Gas) LEL: 8.1% UEL: 17.4% Flammable Gas

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at the Site

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
cis-1,2-Dichloroethene	156-59-2	TWA 200 ppm (All isomers)	TWA 200 ppm (790 mg/m3)	TWA 200 ppm (790 mg/m3)	1000 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, respiratory system; central nervous system depression	Eyes, respiratory system, central nervous system	Colorless liquid (usually a mixture of the cis & trans isomers) with a slightly acrid, chloroform-like odor. BP: 118-140°F Fl.Pt. = 36-39°F LEL: 5.6% UEL: 12.8% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F
cis-1,3-Dichloropropene	10061-01-5	https://cameochemicals.noaa.gov/chemical/20168				Inhalation, ingestion, skin and/or eye contact	Symptoms of exposure to this compound may include local irritation of the eyes skin and respiratory tract; dermatitis, gasping, coughing, substernal pain, extreme respiratory distress, lacrimation, central nervous system depression, skin irritation, acute gastrointestinal distress with pulmonary congestion and edema. It also may cause injury to the liver, kidneys and heart.	Skin, eyes, mucous membranes, liver, kidney, heart	Colorless to amber liquid with a sweetish odor. BP: 219.7°F Fl.Pt. = NA LEL: NA UEL: NA
Cyclohexane	110-82-7	TWA 100 ppm	TWA 300 ppm (1050 mg/m3)	TWA 300 ppm (1050 mg/m3)	1300 ppm [10%LEL]	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, respiratory system; drowsiness; dermatitis; narcosis, coma	Eyes, skin, respiratory system, central nervous system	Colorless liquid with a sweet, chloroform-like odor. [Note: A solid below 44°F.] BP: 177°F Fl.Pt. = 0°F LEL: 1.3% UEL: 8.0% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F.
Dibromochloromethane	124-48-1	https://cameochemicals.noaa.gov/chemical/16183				Inhalation, ingestion, skin and/or eye contact	Symptoms of exposure to this compound may include irritation of the skin, eyes, mucous membranes and upper respiratory tract. It may also cause fatigue. Other symptoms may include central nervous system effects, lung and cornea irritation and liver and kidney damage. Prolonged exposure can cause nausea, dizziness, headache and narcosis.	Skin, eyes, mucous membranes, upper respiratory tract	Clear colorless to yellow-orange liquid BP: 246-248°F Fl.Pt. = Greater than 200°F LEL: NA UEL: NA
Dichlorodifluoromethane	75-71-8	TWA 1000 ppm	TWA 1000 ppm (4950 mg/m3)	TWA 1000 ppm (4950 mg/m3)	15,000 ppm	Inhalation, skin and/or eye contact (liquid)	Dizziness, tremor, asphyxia, unconsciousness, cardiac arrhythmias, cardiac arrest; liquid: frostbite	Cardiovascular system, peripheral nervous system	Colorless gas with an ether-like odor at extremely high concentrations. [Note: Shipped as a liquefied compressed gas.] BP: -22°F Fl.Pt. = NA LEL: NA UEL: NA Nonflammable Gas
Ethylbenzene	100-41-4	TWA 20 ppm	TWA 100 ppm (435 mg/m^3) ST 125 ppm (545 mg/m^3)	TWA 100 ppm (435 mg/m^3)	800 ppm [10%LEL]	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, mucous membrane; headache; dermatitis; narcosis, coma	Eyes, skin, respiratory system, central nervous system	Colorless liquid with an aromatic odor. BP: 277°F Fl.Pt. = 55°F LEL: 0.8% UEL: 6.7% Class IB Flammable Liquid below 73°F and BP at or above 100°F
Isopropylbenzene	98-82-8	TWA 1 ppm	TWA 50 ppm (245 mg/m3) [skin]	TWA 50 ppm (245 mg/m3) [skin]	900 ppm [10%LEL]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, mucous membrane; dermatitis; headache, narcosis, coma	Eyes, skin, respiratory system, central nervous system	Colorless liquid with a sharp, penetrating, aromatic odor BP: 306°F Fl.Pt. = 96°F LEL: 0.9% UEL: 6.5% Class IC Flammable Liquid: Fl.P. at or above 73°F and below 100°F
m&p-Xylenes	179601-23-1								
Methyl Acetate	79-20-9	TWA 200 ppm STEL 250 ppm	TWA 200 ppm (610 mg/m3) ST 250 ppm (760 mg/m3)	TWA 200 ppm (610 mg/m3)	3100 ppm [10%LEL]	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; headache, drowsiness; optic nerve atrophy; chest tightness; In Animals: narcosis	Eyes, skin, respiratory system, central nervous system	Colorless liquid with a fragrant, fruity odor BP: 135°F Fl.Pt. = 14°F LEL: 3.1% UEL: 16% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F.

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at the Site

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
Methylcyclohexane	108-87-2	TWA 400 ppm	TWA 400 ppm (1600 mg/m3)	TWA 500 ppm (2000 mg/m3)	1200 ppm [LEL]	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; dizziness, drowsiness; In Animals: narcosis	Eyes, skin, respiratory system, central nervous system	Colorless liquid with a faint, benzene-like odor BP: 214°F Fl.Pt. = 25°F LEL: 1.2% UEL: 6.7% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F.
Methylene chloride	75-09-2	TWA 50 ppm	Ca	[1910.1052] TWA 25 ppm ST 125 ppm	Ca [2300 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin; lassitude (weakness, exhaustion), drowsiness, dizziness; numb, tingle limbs; nausea; [potential occupational carcinogen]	Eyes, skin, cardiovascular system, central nervous system	Colorless liquid with a chloroform-like odor. [Note: A gas above 104°F.] BP: 104°F Fl.Pt. = NA LEL: 13% UEL: 23% Combustible Liquid
Methyl-t-butyl ether	1634-04-4	TWA 50 ppm				Inhalation, skin absorption, ingestion, skin and/or eye contact	May cause dizziness or suffocation. Contact may irritate or burn eyes or skin. May be harmful if swallowed.	Eyes, skin	A colorless liquid with a distinctive anesthetic-like odor. BP: 131°F Fl.Pt. = -14°F LEL: NA UEL: NA
o-Xylene	95-47-6	TWA 100 ppm STEL 150 ppm (All isomers)	TWA 100 ppm (435 mg/m3) ST 150 ppm (655 mg/m3)	TWA 100 ppm (435 mg/m3)	900 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; dizziness, excitement, drowsiness, incoordination, staggering gait; corneal vacuolization; anorexia, nausea, vomiting, abdominal pain; dermatitis	Eyes, skin, respiratory system, central nervous system, gastrointestinal tract, blood, liver, kidneys	Colorless liquid with an aromatic odor BP: 292°F Fl.Pt. = 90°F LEL: 0.9% UEL: 6.7% Class IC Flammable Liquid: Fl.P. at or above 73°F and below 100°F
Styrene	100-42-5	TWA (20 ppm) STEL (40 ppm)	TWA 50 ppm (215 mg/m3) ST 100 ppm (425 mg/m3)	TWA 100 ppm C 200 ppm 600 ppm (5-minute maximum peak in any 3 hours)	700 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, nose, respiratory system; headache, lassitude (weakness, exhaustion), dizziness, confusion, malaise (vague feeling of discomfort), drowsiness, unsteady gait; narcosis; defatting dermatitis; possible liver injury; reproductive effects	Eyes, skin, respiratory system, central nervous system, liver, reproductive system	Colorless to yellow, oily liquid with a sweet, floral odor BP: 293°F Fl.Pt. = 88°F LEL: 0.9% UEL: 6.8% Class IC Flammable Liquid: Fl.P. at or above 73°F and below 100°F
Tetrachloroethene	127-18-4	TWA 25 ppm STEL 100 ppm	Ca Minimize workplace exposure concentrations	TWA 100 ppm C 200 ppm (for 5 minutes in any 3-hour period), with a maximum peak of 300 ppm	Ca [150 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat, respiratory system; nausea; flush face, neck; dizziness, incoordination; headache, drowsiness; skin erythema (skin redness); liver damage; [potential occupational carcinogen]	Eyes, skin, respiratory system, liver, kidneys, central nervous system	Colorless liquid with a mild, chloroform-like odor BP: 250°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Liquid, but decomposes in a fire to hydrogen chloride and phosgene
Sodium Hydroxide	1310-73-2	STEL C 2 mg/m^3	C 2 mg/m^3	TWA 2 mg/m^3	10 mg/m^3	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, mucous membrane; pneumonitis; eye, skin burns; temporary loss of hair	Eyes, skin, respiratory system	Colorless to white, odorless solid (flakes, beads, granular form). BP: 2534°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solid, but when in contact with water may generate sufficient heat to ignite combustible materials.
Sulfuric Acid	7664-93-9	TWA 0.2 mg/m^3	TWA 1 mg/m^3	TWA 1 mg/m^3	15 mg/m^3	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; pulmonary edema, bronchitis; emphysema; conjunctivitis; stomatis; dental erosion; eye, skin burns; dermatitis	Eyes, skin, respiratory system, teeth	Colorless to dark-brown, oily, odorless liquid.[Note: Pure compound is a solid below 51°F. Often used in an aqueous solution.] BP = 554°F Fl.Pt. = NA LEL = NA UEL = NA Noncombustible Liquid, but capable of igniting finely divided combustible materials.

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at the Site

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
trans-1,2-Dichloroethene	156-60-5	200 ppm (All isomers)	TWA 200 ppm (790 mg/m3)	TWA 200 ppm (790 mg/m3)	1000 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, respiratory system; central nervous system depression	Eyes, respiratory system, central nervous system	Colorless liquid (usually a mixture of the cis & trans isomers) with a slightly acrid, chloroform-like odor. BP: 118-140°F Fl.P: 36-39°F LEL: 5.6% UEL: 12.8% Class IB Flammable Liquid Fl.P. below 73°F and BP at or above 100°F.
trans-1,3-Dichloropropene	10061-02-6	https://cameochemicals.noaa.gov/chemical/18110				Inhalation, ingestion, skin and/or eye contact	Symptoms of exposure to this compound may include local irritation of the eyes skin and respiratory tract, dermatitis, gasping, coughing, substernal pain, extreme respiratory distress, lacrimation, central nervous system depression, acute gastrointestinal distress with pulmonary congestion and edema. It may also cause injury to the liver, kidneys and heart	Skin, eyes, mucous membranes, liver, kidney, heart	A clear colorless liquid with chloroform odor BP: 234°F Fl.P: NA LEL: NA UEL: NA
Toluene	108-88-3	TWA 20 ppm	TWA 100 ppm (375 mg/m^3) ST 150 ppm (560 mg/m^3)	TWA 200 ppm C 300 ppm 500 ppm (10-minute maximum peak)	500 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	irritation eyes, nose; lassitude (weakness, exhaustion), confusion, euphoria, dizziness, headache; dilated pupils, lacrimation (discharge of tears); anxiety, muscle fatigue, insomnia; paresthesia; dermatitis; liver, kidney damage	Eyes, skin, respiratory system, central nervous system, liver, kidneys	Colorless liquid with a sweet, pungent, benzene-like odor. BP: 232°F Fl.P: 40°F LEL: 1.1% UEL: 7.1% Class IB Flammable Liquid Fl.P. below 73°F and BP at or above 100°F.
Trichloroethene (TCE)	79-01-6	TWA 10 ppm STEL 25 ppm	Ca	TWA 100 ppm C 200 ppm 300 ppm (5-minute maximum peak in any 2 hours)	Ca [1000 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin; headache, visual disturbance, lassitude (weakness, exhaustion), dizziness, tremor, drowsiness, nausea, vomiting; dermatitis; cardiac arrhythmias, paresthesia; liver injury; [potential occupational carcinogen]	Eyes, skin, respiratory system, heart, liver, kidneys, central nervous system	Colorless liquid (unless dyed blue) with a chloroform-like odor. BP: 189°F Fl.Pt. = NA LEL(77°F): 8.0% UEL(77°F): 10.5% Combustible Liquid, but burns with difficulty.
Trichlorofluoromethane	75-69-4	STEL C 1000 ppm	C 1000 ppm (5600 mg/m3)	TWA 1000 ppm (5600 mg/m3)	2000 ppm	Inhalation, ingestion, skin and/or eye contact	Incoordination, tremor; dermatitis; cardiac arrhythmias, cardiac arrest; asphyxia; liquid: frostbite	Skin, respiratory system, cardiovascular system	Colorless to water-white, nearly odorless liquid or gas (above 75°F) BP: 75°F Fl.P: NA LEL: NA UEL: NA Noncombustible Liquid Nonflammable Gas
Vinyl Chloride (chloroethylene)	75-01-4	TWA 1 ppm	Ca	TWA 1 ppm C 5 ppm [15-minute]	Ca (ND)	Inhalation, skin and/or eye contact (liquid)	Lassitude (weakness, exhaustion); abdominal pain, gastrointestinal bleeding; enlarged liver; pallor or cyanosis of extremities; liquid: frostbite; [potential occupational carcinogen]	Liver, central nervous system, blood, respiratory system, lymphatic system	Colorless gas or liquid (below 7°F) with a pleasant odor at high concentrations.[Note: Shipped as a liquefied compressed gas.] BP: 7°F Fl.Pt. = NA (Gas) LEL: 3.6% UEL: 33.0% Flammable Gas
Xylene (m, o & p isomers)	108-38-3, 95-47-6, 106-42-3	TWA 100 ppm STEL 150 ppm	TWA 100 ppm (435 mg/m^3) ST 150 ppm (655 mg/m^3)	TWA 100 ppm (435 mg/m^3)	900 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; dizziness, excitement, drowsiness, incoordination, staggering gait; corneal vacuolization; anorexia, nausea, vomiting, abdominal pain; dermatitis	Eyes, skin, respiratory system, central nervous system, gastrointestinal tract, blood, liver, kidneys	Colorless liquid with an aromatic odor BP: 282°F, 292°F, 281°F Fl. Pt. 82°F, 90°F, 81°F LEL: 1.1%, 0.9%, 1.1% UEL: 7.0%, 6.7%, 7.0% Class IC Flammable Liquid at or above 73°F and below 100°F.
Zinc Oxide (dust)	7440-66-6	TWA 2 mg/m3 STEL 10 mg/m^3	TWA 5 mg/m^3 C 15 mg/m^3	TWA 15 mg/m^3 (total dust) TWA 5 mg/m^3 (resp dust)	500 mg/m^3	Inhalation	Metal fume fever: chills, muscle ache, nausea, fever, dry throat, cough; lassitude (weakness, exhaustion); metallic taste; headache; blurred vision; low back pain; vomiting; malaise (vague feeling of discomfort); chest tightness; dyspnea (breathing difficulty), rales, decreased pulmonary function	Respiratory system	White, odorless solid. BP: NA Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solid
SEMI-VOLATILE ORGANIC COMPOUNDS (SVOCs)									
2-Chloronaphthalene	91-58-7	https://cameochemicals.noaa.gov/chemical/16185				Inhalation, ingestion, skin and/or eye contact	Chloracne, cysts, headache, fatigue, vertigo, anorexia and jaundice		Monoclinic plates or off-white crystalline powder BP: NA Fl.Pt. = NA LEL: NA UEL: NA

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at the Site

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
2-Methylnapthalene	91-57-6	TWA 0.5 ppm	https://cameochemicals.noaa.gov/chemical/20668			Inhalation, ingestion, skin and/or eye contact	Headaches, nausea, vomiting, diarrhea, anemia, jaundice, euphoria, dermatitis, visual disturbances, convulsions and comatose	Skin, eyes, mucous membranes and upper respiratory tract	White crystalline solid Combustible solid BP: 466-468 ° F Fl.Pt. = 208 ° F LEL: NA UEL: NA
Acenaphthene	83-32-9	https://cameochemicals.noaa.gov/chemical/10358				Inhalation, ingestion, skin and/or eye contact	Irritation of the skin, eyes, mucous membranes and upper respiratory tract, vomiting	Skin, eyes, mucous membranes and upper respiratory tract	White needles BP: 534 ° F Fl.Pt. = NA LEL: 0.6% UEL: NA
Acenaphthylene	208-96-8	https://cameochemicals.noaa.gov/chemical/16157				Inhalation, ingestion, skin and/or eye contact			Colorless crystalline solid BP: 509 to 527 ° F at 760 mm Hg Fl.Pt. = NA LEL: NA UEL: NA
Anthracene	120-12-7	None listed	Ca TWA 0.1 mg/m3 (cyclohexane-extractable fraction)	TWA 0.2 mg/m3 (benzene-soluble fraction) [1910.1002]	Ca [80 mg/m3]	Inhalation, skin and/or eye contact	Dermatitis, bronchitis, [potential occupational carcinogen]	Respiratory system, skin, bladder, kidneys	Black or dark-brown amorphous residue BP: NA Fl.Pt. = NA LEL: NA UEL: NA Combustible Solids
Benzo[a]anthracene	56-55-3	https://cameochemicals.noaa.gov/chemical/16171				Inhalation, injestion, skin and/or eye contact			Colorless leaflets or plates or coarse gold powder with a greenish-yellow fluorescence. May reasonably be expected to be a carcinogen. BP: 815° F at 760 mm Hg Fl.Pt. = NA LEL: NA UEL: NA
Benzo[a]pyrene	50-32-8	None listed	Ca TWA 0.1 mg/m3 (cyclohexane-extractable fraction)	TWA 0.2 mg/m3 (benzene-soluble fraction) [1910.1002]	Ca [80 mg/m3]	Inhalation, skin and/or eye contact	Dermatitis, bronchitis, [potential occupational carcinogen]	Respiratory system, skin, bladder, kidneys	Black or dark-brown amorphous residue BP: NA Fl.Pt. = NA LEL: NA UEL: NA Combustible Solids
Benzo[b]fluoranthene	205-99-2	None listed	https://cameochemicals.noaa.gov/chemical/16172			Inhalation, injestion, skin and/or eye contact			Needles or yellow fluffy powder BP: NA Fl.Pt. = NA LEL: NA UEL: NA
Benzo[g,h,i]perylene	191-24-2	https://cameochemicals.noaa.gov/chemical/16174				Inhalation, injestion, skin and/or eye contact	Inhalation of material may be harmful. Contact may cause burns to skin and eyes. Inhalation of Asbestos dust may have a damaging effect on the lungs. Fire may produce irritating, corrosive and/or toxic gases. Some liquids produce vapors that may cause dizziness or suffocation. Runoff from fire control may cause pollution.	Lungs, skin, eyes	Colorless to white crystalline solid. Water insoluble. BP: NA Fl.Pt. = NA LEL: NA UEL: NA
Benzo[k]fluoranthene	207-08-9	https://cameochemicals.noaa.gov/chemical/16173				Inhalation, injestion, skin and/or eye contact	When heated to decomposition this compound emits acrid smoke and irritating fumes.		Pale yellow needles or yellow crystalline solid BP: 896° F Fl.Pt. = NA LEL: NA UEL: NA
Chrysene	218-01-9	None listed	Ca TWA 0.1 mg/m3 (cyclohexane-extractable fraction)	TWA 0.2 mg/m3 (benzene-soluble fraction) [1910.1002]	Ca [80 mg/m3]	Inhalation, skin and/or eye contact	Dermatitis, bronchitis, [potential occupational carcinogen]	Respiratory system, skin, bladder, kidneys	Black or dark-brown amorphous residue BP: NA Fl.Pt. = NA LEL: NA UEL: NA Combustible Solids
Dibenzo(a,h)anthracene	53-70-3	https://cameochemicals.noaa.gov/chemical/16192				Inhalation, injestion, skin and/or eye contact	Symptoms of exposure to this compound may include irritation. This compound is harmful if swallowed or inhaled. It may cause irritation. When heated to decomposition it emits acrid smoke, irritating fumes and toxic fumes of carbon monoxide and carbon dioxide.	Lungs	White crystals or pale yellow solid. Sublimes BP: 975° F Fl.Pt. = NA LEL: NA UEL: NA

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at the Site

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
Fluoranthene	206-44-0	https://cameochemicals.noaa.gov/chemical/16213				Inhalation, injestion, skin and/or eye contact	When heated to decomposition this compound emits acrid smoke and fumes.		Light yellow fine crystals BP: 482° F Fl.Pt. = NA LEL: NA UEL: NA
Fluorene	86-73-7	https://cameochemicals.noaa.gov/chemical/16214				Inhalation, injestion, skin and/or eye contact			White leaflets. Sublimes easily under a vacuum. Fluorescent when impure. BP: 563° F Fl.Pt. = NA LEL: NA UEL: NA
Indeno[1,2,3-cd]pyrene	193-39-5	https://cameochemicals.noaa.gov/chemical/16218				Inhalation, injestion, skin and/or eye contact			Yellow crystals BP: 997° F Fl.Pt. = NA LEL: NA UEL: NA
Naphthalene	91-20-3	TWA 10 ppm	TWA 10 ppm (50 mg/m3) ST 15 ppm (75 mg/m3)	TWA 10 ppm (50 mg/m3)	250 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes; headache, confusion, excitement, malaise (vague feeling of discomfort); nausea, vomiting, abdominal pain; irritation bladder; profuse sweating; jaundice; hematuria (blood in the urine), renal shutdown; dermatitis, optical neuritis, corneal damage	Eyes, skin, blood, liver, kidneys, central nervous system	Colorless to brown solid with an odor of mothballs. [Note: Shipped as a molten solid.] BP: 424°F Fl.P: 174°F LEL: 0.9% UEL: 5.9% Combustible Solid, but will take some effort to ignite
Phenanthrene	85-01-8	https://cameochemicals.noaa.gov/chemical/16236				Inhalation, injestion, skin and/or eye contact	Symptoms following exposure to this compound may include skin sensitization, dermatitis, bronchitis, cough, dyspnea, respiratory neoplasm, kidney neoplasm, skin irritation, and respiratory irritation.	Skin, respiratory tract	Colorless monoclinic crystals with a faint aromatic odor. Solutions exhibit a blue fluorescence. BP: 642° F Fl.Pt. = 340° F LEL: NA UEL: NA
Pyrene	129-00-0	None listed	Ca TWA 0.1 mg/m3 (cyclohexane-extractable fraction)	TWA 0.2 mg/m3 (benzene-soluble fraction) [1910.1002]	Ca [80 mg/m3]	Inhalation, skin and/or eye contact	Dermatitis, bronchitis, [potential occupational carcinogen]	Respiratory system, skin, bladder, kidneys	Black or dark-brown amorphous residue BP: NA Fl.Pt. = NA LEL: NA UEL: NA Combustible Solids
METALS									
Aluminum	7429-90-5	TWA 1 mg/m3	TWA 10 mg/m^3 (total) TWA 5 mg/m^3 (resp)	TWA 15 mg/m^3 (total) TWA 5 mg/m^3 (resp)	N.D.	Inhalation, skin and/or eye contact	Irritation eyes, skin, respiratory system	Eyes, skin, respiratory system	Silvery-white, malleable, ductile, odorless metal BP: 4221°F Fl.Pt. = NA LEL: NA UEL: NA Combustible Solid, finely divided dust is easily ignited; may cause explosions.
Antimony	7440-36-0	TWA 0.5 mg/m3	TWA 0.5 mg/m3 [*Note: The REL also applies to other antimony compounds (as Sb).]	TWA 0.5 mg/m3 [*Note: The PEL also applies to other antimony compounds (as Sb).]	50 mg/m3 (as Sb)	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat, mouth; cough; dizziness; headache; nausea, vomiting, diarrhea; stomach cramps; insomnia; anorexia; unable to smell properly	Eyes, skin, respiratory system, cardiovascular system	Silver-white, lustrous, hard, brittle solid; scale-like crystals; or a dark-gray, lustrous powder BP: 2975°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solid in bulk form, but a moderate explosion hazard in the form of dust when exposed to flame.
Arsenic	7440-38-2	TWA 0.01 mg/m3	Ca C 0.002 mg/m3 [15-minute]	[1910.1018] TWA 0.010 mg/m3	Ca [5 mg/m3 (as As)]	Inhalation, skin absorption, skin and/or eye contact, ingestion	Ulceration of nasal septum, dermatitis, gastrointestinal disturbances, peripheral neuropathy, resp irritation, hyperpigmentation of skin, [potential occupational carcinogen]	Liver, kidneys, skin, lungs, lymphatic system	Metal: Silver-gray or tin-white, brittle, odorless solid BP: Sublimes Fl.Pt. = NA LEL: NA UEL: NA Metal: Noncombustible Solid in bulk form, but a slight explosion hazard in the form of dust when exposed to flame

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at the Site

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
Barium	7440-39-3	TWA 0.5 mg/m3	0.5 mg Ba/m3 TWA	0.5 mg Ba/m3 TWA	50 mg Ba/m3	Inhalation, ingestion, skin and/or eye contact	Inhalation or contact with vapors, substance or decomposition products may cause severe injury or death. Contact may cause burns to skin, eyes, and mucous membranes. May be toxic by ingestion, inhalation and skin absorption. Used to make other chemicals.	Lungs, skin, eyes, and mucous membrane	A silver to white metallic solid BP: 1337°F Fl.Pt. = NA LEL: NA UEL: NA
Beryllium	7440-41-7	TWA 0.00005 mg/m^3	Ca C 0.0005 mg/m^3	STEL 0.002 mg/m^3 TWA 0.0002 mg/m^3	Ca [4 mg/m^3 (as Be)]	Inhalation, skin and/or eye contact	Berylliosis (chronic exposure): anorexia, weight loss, lassitude (weakness, exhaustion), chest pain, cough, clubbing of fingers, cyanosis, pulmonary insufficiency; irritation eyes; dermatitis; [potential occupational carcinogen]	Eyes, skin, respiratory system	Hard, brittle, gray-white solid BP: 4532°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solid in bulk form, but a slight explosion hazard in the form of a powder or dust.
Cadmium	7440-43-9	TWA 0.01 mg/m^3 TWA 0.002 mg/m^3 (as Cd)	Ca	TWA 0.005 mg/m^3	Ca [9 mg/m3 (as Cd)]	Inhalation, ingestion	Pulmonary edema, dyspnea (breathing difficulty), cough, chest tightness, substernal (occurring beneath the sternum) pain; headache; chills, muscle aches; nausea, vomiting, diarrhea; anosmia (loss of the sense of smell), emphysema, proteinuria, mild anemia; [potential occupational carcinogen]	Respiratory system, kidneys, prostate, blood	Silver-white/blue tinged lustrous, odorless solid. BP: 1409°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible - will burn in powder form
Calcium	7440-70-2	https://cameochemicals.noaa.gov/chemical/309				Inhalation, ingestion, skin and/or eye contact	Contact with eyes or skin produces caustic burns.	Eyes, skin	A silvery, soft metal that turns grayish white on exposure to air. BP: 2714°F Fl.Pt. = NA LEL: NA UEL: NA
Chromium	7440-47-3	TWA 0.5 mg/m^3 (metal) TWA 0.003 mg/m^3 (water-soluble Cr III compounds) TWA 0.0002 mg/m^3 (water-soluble Cr VI compounds)	TWA 0.5 mg/m^3	TWA 1 mg/m^3	250 mg/m^3 (as Cr)	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin; lung fibrosis (histologic)	Eyes, skin, respiratory system	Blue-white to steel-gray, lustrous, brittle, hard, odorless solid. BP: 4788°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible - will burn in dust form if heated in a flame
Cobalt	7440-48-4	TWA 0.02 mg/m3	TWA 0.05 mg/m3	TWA 0.1 mg/m3	20 mg/m3 (as Co)	Inhalation, ingestion, skin and/or eye contact	Cough, dyspnea (breathing difficulty), wheezing, decreased pulmonary function; weight loss; dermatitis; diffuse nodular fibrosis; resp hypersensitivity, asthma	Skin, respiratory system	Odorless, silver-gray to black solid BP: 5612°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solid in bulk form, but finely divided dust will burn at high temperatures.
Copper	7440-50-8	TWA 0.2 mg/m^3 (fume) TWA 1 mg/m3 (dusts and mists)	TWA 1 mg/m^3	TWA 1 mg/m^3	100 mg/m^3 (as Cu)	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, nose, pharynx; nasal septum perforation; metallic taste; dermatitis; In Animals: lung, liver, kidney damage; anemia	Eyes, skin, respiratory system, liver, kidneys (increased risk with Wilson's disease)	Reddish, lustrous, malleable, odorless solid. BP: 4703°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible - powdered form may ignite
Iron	7439-89-6	TWA 1 mg/m3	TWA 1 mg/m^3	NA	NA	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, mucous membrane; abdominal pain, diarrhea, vomiting; possible liver damage	Eyes, skin, respiratory system, liver, gastrointestinal tract	Appearance and odor vary depending upon the specific soluble iron salt. BP: NA Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solids
Lead	7439-92-1	TWA 0.05 mg/m3	TWA (8-hour) 0.050 mg/m3	[1910.1025] TWA 0.050 mg/m3	100 mg/m3 (as Pb)	Inhalation, ingestion, skin and/or eye contact	Lassitude (weakness, exhaustion), insomnia; facial pallor; anorexia, weight loss, malnutrition; constipation, abdominal pain, colic; anemia; gingival lead line; tremor; paralysis wrist, ankles; encephalopathy; kidney disease; irritation eyes; hypertension	Eyes, gastrointestinal tract, central nervous system, kidneys, blood, gingival tissue	A heavy, ductile, soft, gray solid BP: 3164°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solid in bulk form

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at the Site

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
Magnesium	7439-95-4	https://cameochemicals.noaa.gov/chemical/6949				Eye and/or skin contact	Dust irritates eyes in same way as any foreign material. Penetration of skin by fragments of metal is likely to produce local irritation, blisters, and ulcers which may become infected.	Eyes	A light silvery metal BP: 1202°F Fl.Pt. = NA LEL: NA UEL: NA
Manganese	7439-96-5	TWA 0.02 mg/m3 [R] TWA 0.1 mg/m3 [I]	TWA 1 mg/m3 ST 3 mg/m3	C 5 mg/m3	500 mg/m3 (as Mn)	inhalation, ingestion	Manganism; asthenia, insomnia, mental confusion; metal fume fever: dry throat, cough, chest tightness, dyspnea (breathing difficulty), rales, flu-like fever; low-back pain; vomiting; malaise (vague feeling of discomfort); lassitude (weakness, exhaustion); kidney damage	respiratory system, central nervous system, blood, kidneys	A lustrous, brittle, silvery solid BP: 3564°F Fl.Pt. = NA LEL: NA UEL: NA Metal: Combustible Solid
Mercury	7439-97-6	TWA 0.01 mg/m3 STEL 0.03 mg/m3	Hg Vapor: TWA 0.05 mg/m3 [skin] Other: C 0.1 mg/m3 [skin]	TWA 0.1 mg/m3	10 mg/m3 (as Hg)	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin; cough, chest pain, dyspnea (breathing difficulty), bronchitis, pneumonitis; tremor, insomnia, irritability, indecision, headache, lassitude (weakness, exhaustion); stomatitis, salivation; gastrointestinal disturbance, anorexia, weight loss; proteinuria	Eyes, skin, respiratory system, central nervous system, kidneys	Metal: Silver-white, heavy, odorless liquid. [Note: "Other" Hg compounds include all inorganic & aryl Hg compounds except (organo) alkyls.] BP: 674°F Fl.Pt. = NA LEL: NA UEL: NA Metal: Noncombustible Liquid
Nickel	7440-02-0	TWA 1.5 mg/m^3 [elemental] TWA 0.1 mg/m^3 [soluble inorganic compound] TWA 0.2 mg/m^3 [insoluble inorganic compound] TWA 0.1 mg/m^3 [Nickel subsulfide]	Ca TWA 0.015 mg/m^3	TWA 1 mg/m^3	Ca [10 mg/m3 (as Ni)]	Inhalation, ingestion, skin and/or eye contact	Sensitization dermatitis, allergic asthma, pneumonitis; [potential occupational carcinogen]	Nasal cavities, lungs, skin	Lustrous, silvery, odorless solid. BP: 5139°F Fl.Pt. = NA LEL: NA UEL: NA Combustible Solid; nickel sponge catalyst may ignite spontaneously in air.
Potassium	9/7/7440	https://cameochemicals.noaa.gov/chemical/4289				Eye and/or skin contact	Will burn skin and eyes	Skin, eyes	Potassium is a soft silvery metal though normally grayish white due to oxidation BP: 1425°F Fl.Pt. = NA LEL: NA UEL: NA
Selenium	7782-49-2	TWA 0.2 mg/m3	TWA 0.2 mg/m3	TWA 0.2 mg/m3	1 mg/m3 (as Se)	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; visual disturbance; headache; chills, fever; dyspnea (breathing difficulty), bronchitis; metallic taste, garlic breath, gastrointestinal disturbance; dermatitis; eye, skin burns; In Animals: anemia; liver necrosis, cirrhosis; kidney, spleen damage	Eyes, skin, respiratory system, liver, kidneys, blood, spleen	Amorphous or crystalline, red to gray solid. [Note: Occurs as an impurity in most sulfide ores.] BP: 1265°F Fl.Pt. = NA LEL: NA UEL: NA Combustible Solid
Silver	7440-22-4	TWA 0.1 mg/m3 [Metal, dust, and fume] TWA 0.01 mg/m3 [Soluble compounds, as Ag]	TWA 0.01 mg/m3	TWA 0.01 mg/m3	10 mg/m3 (as Ag)	Inhalation, ingestion, skin and/or eye contact	Blue-gray eyes, nasal septum, throat, skin; irritation, ulceration skin; gastrointestinal disturbance	Nasal septum, skin, eyes	Metal: White, lustrous solid BP: 3632°F Fl.Pt. = NA LEL: NA UEL: NA Metal: Noncombustible Solid, but flammable in form of dust or powder
Sodium	7440-23-5	https://cameochemicals.noaa.gov/chemical/7794				Skin contact	Severe burns caused by burning metal or by caustic soda formed by reaction with moisture on skin	Skin	A silvery soft metal that becomes grayish white upon exposure to air BP: 1621°F Fl.Pt. = NA LEL: NA UEL: NA
Thallium	7440-28-0	0.02 mg/m3 [I]	TWA 0.1 mg/m3 [skin]	TWA 0.1 mg/m3 [skin]	15 mg/m3 (as Tl)	Inhalation, skin absorption, ingestion, skin and/or eye contact	Nausea, diarrhea, abdominal pain, vomiting; ptosis, strabismus; peri neuritis, tremor; retrosternal (occurring behind the sternum) tightness, chest pain, pulmonary edema; convulsions, chorea, psychosis; liver, kidney damage; alopecia; paresthesia legs	Eyes, respiratory system, central nervous system, liver, kidneys, gastrointestinal tract, body hair	Appearance and odor vary depending upon the specific soluble thallium compound BP: NA Fl.Pt. = NA LEL: NA UEL: NA
Vanadium	7440-62-2	https://cameochemicals.noaa.gov/chemical/16147				Inhalation, skin absorption, ingestion, skin and/or eye contact	Highly toxic, may be fatal if inhaled, swallowed or absorbed through skin. Avoid any skin contact. Effects of contact or inhalation may be delayed. Fire may produce irritating, corrosive and/or toxic gases. Runoff from fire control or dilution water may be corrosive and/or toxic and cause pollution	Skin	Silvery-whitish powder BP: NA Fl.Pt. = NA LEL: NA UEL: NA

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at the Site

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
Zinc	7440-66-6	https://cameochemicals.noaa.gov/chemical/4814				Inhalation, skin absorption, ingestion, skin and/or eye contact	Inhalation or contact with vapors, substance or decomposition products may cause severe injury or death. May produce corrosive solutions on contact with water. Fire will produce irritating, corrosive and/or toxic gases. Runoff from fire control may cause pollution	Lungs	A grayish powder BP: NA Fl.Pt. = NA LEL: NA UEL: NA
PCBs									
PCBs (total)	11097-69-1, 53469-21-9	TWA 0.5 mg/m3 TWA 1 mg/m3	Ca TWA 0.001 mg/m3 Ca TWA 0.001 mg/m3	TWA 0.5 mg/m3 [skin] TWA 1 mg/m3 [skin]	Ca [5 mg/m3] Ca [5 mg/m3]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, chloracne; liver damage; reproductive effects; [potential occupational carcinogen]	Skin, eyes, liver, reproductive system	Colorless to pale-yellow, viscous liquid or solid (below 50°F) with a mild, hydrocarbon odor BP: 689-734°F, 617-691°F Fl.Pt. = NA, NA LEL: NA UEL: NA Nonflammable Liquid, but exposure in a fire results in the formation of a black soot containing PCBs, polychlorinated dibenzofurans, and chlorinated dibenzo-p-dioxins.
Petroleum Hydrocarbons									
Gasoline	86290-81-5	TWA 300 ppm STEL 500 ppm	Ca	None	Ca [N.D.]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, mucous membrane; dermatitis; headache, lassitude (weakness, exhaustion), blurred vision, dizziness, slurred speech, confusion, convulsions; chemical pneumonitis (aspiration liquid); possible liver, kidney damage; [potential occupational carcinogen]	Eyes, skin, respiratory system, central nervous system, liver, kidneys	Clear liquid with a characteristic odor BP: 102°F Fl.Pt. = -45°F LEL: 1.4% UEL: 7.6%

References

Centers for Disease Control and Prevention, 2018. *NIOSH Pocket Guide to Chemical Hazards.* The National Institute for Occupational Safety and Health.
American Conference of Governmental Industrial Hygienists (ACGIH), 2017. *2017 TLVs® and BEIs®.* Cincinnati, OH.
National Oceanic and Atmospheric Administration (NOAA) and Environmental Protection Agency (EPA), 2019. *CAMEO Chemicals Database* . https://cameochemicals.noaa.gov/
U.S. Department of Labor, 1990. *OSHA Regulated Hazardous Substances.* Industrial Exposure and Control Technologies Government Institutes, Inc.
Sax, N. Van Nostrand and Reinhold Company, 1987. *Hawley's Condensed Chemical Dictionary, 11th Edition.*
Proctor, N.H., J.P. Hughes and M.L. Fischman, 1989. *Chemical Hazards of the Workplace* . Van Nostrand Reinhold. New York.
Sax, N.I. and R.J. Lewis, 1989. *Dangerous Properties of Industrial Materials, 7th Edition.* Van Nostrand Reinhold. New York.

Abbreviations:

ACGIH – American Conference of Governmental Industrial Hygienists.
BP – boiling point at 1 atmosphere, °F
C – Ceiling, is a concentration that should not be exceeded during and part of the working exposure.
Ca – Carcinogenic.
CAS# - Chemical Abstracts Service registry number which is unique for each chemical.
Ft Pt. – Flash point
IDLH - Immediately Dangerous to Life and Health concentrations represent the maximum concentration from which, in the event of respirator failure, one could escape within 30 minutes without a respirator and without experiencing any escape-impairing or irreversible health effects.
LEL – Lower explosive (flammable) limit in air, % by volume (at room temperature)
mg/m^3 – Milligrams of substance per cubic meter of air
NIOSH - National Institute for Occupational Safety and Health.
OSHA – Occupational Safety and Health Administration
PEL - OSHA Permissible Exposure Limit (usually) a time weighted average concentration that must not be exceeded during any 8 hour work shift of a 40 hr work week.
ppm – parts per million
REL – NIOSH Recommended Limit indicated a time weighted average concentration that must not be exceeded during any 10 hour work shift of a 40 hr work week
SG - Specific Gravity
STEL – ACGIH Short-term exposure limit (ST)
TLV - ACGIH Threshold Limit Values (usually 8 hour time weighted average concentrations).
TWA – 8-hour, time-weighted average
UEL – Upper explosive (flammable) limit in air, % by volume (at room temperature)
VP - Vapor Pressure

FIGURES

1. Site Location Map
2. Site Plan with Emergency Muster Area
3. Routes to Urgent Care and Hospital

QUADRANGLE LOCATION

N

1,000 0 1,000'

Title:

SITE LOCATION MAP

BROADWAY TRIANGLE SITE C
59-69 BARTLETT ST, 84-100 THROOP AVE
AND 90-100 GERRY ST, BROOKLYN NY

Prepared for:

UNIFIED NEIGHBORHOOD PARTNERS LLC

ROUX

Compiled by: K.M.	Date: 02/09/21	FIGURE
Prepared by: M.S.R.	Scale: AS SHOWN	1
Project Mgr: B.V.	Project: 3605.0001Y003	
File: 3605.0001Y113.1.mxd		

V:\GIS\PROJECTS\3605\0001Y\113\3605.0001Y113.1.MXD

GERRY STREET

LOT 25
LOT 27
LOT 28
LOT 29
LOT 30
LOT 31
LOT 36
LOT 35
LOT 33

THROOP AVENUE

BARTLETT STREET

N

LEGEND

EMERGENCY MUSTER AREA

SITE BOUNDARY

50 0 50'

Title:

SITE PLAN AND EMERGENCY MUSTER AREA

BROADWAY TRIANGLE SITE C
59-69 BARTLETT ST, 84-100 THROOP AVE
AND 90-100 GERRY ST, BROOKLYN NY

Prepared for:

UNIFIED NEIGHBORHOOD PARTNERS LLC

ROUX

Compiled by: K.M.	Date: 02/09/21	FIGURE
Prepared by: M.S.R.	Scale: AS SHOWN	2
Project Mgr: B.V.	Project: 3065.0001Y000	
File: 3605.0001Y113.2.mxd		

V:\GIS\PROJECTS\3605\0001Y113\3605.0001Y113.2.MXD

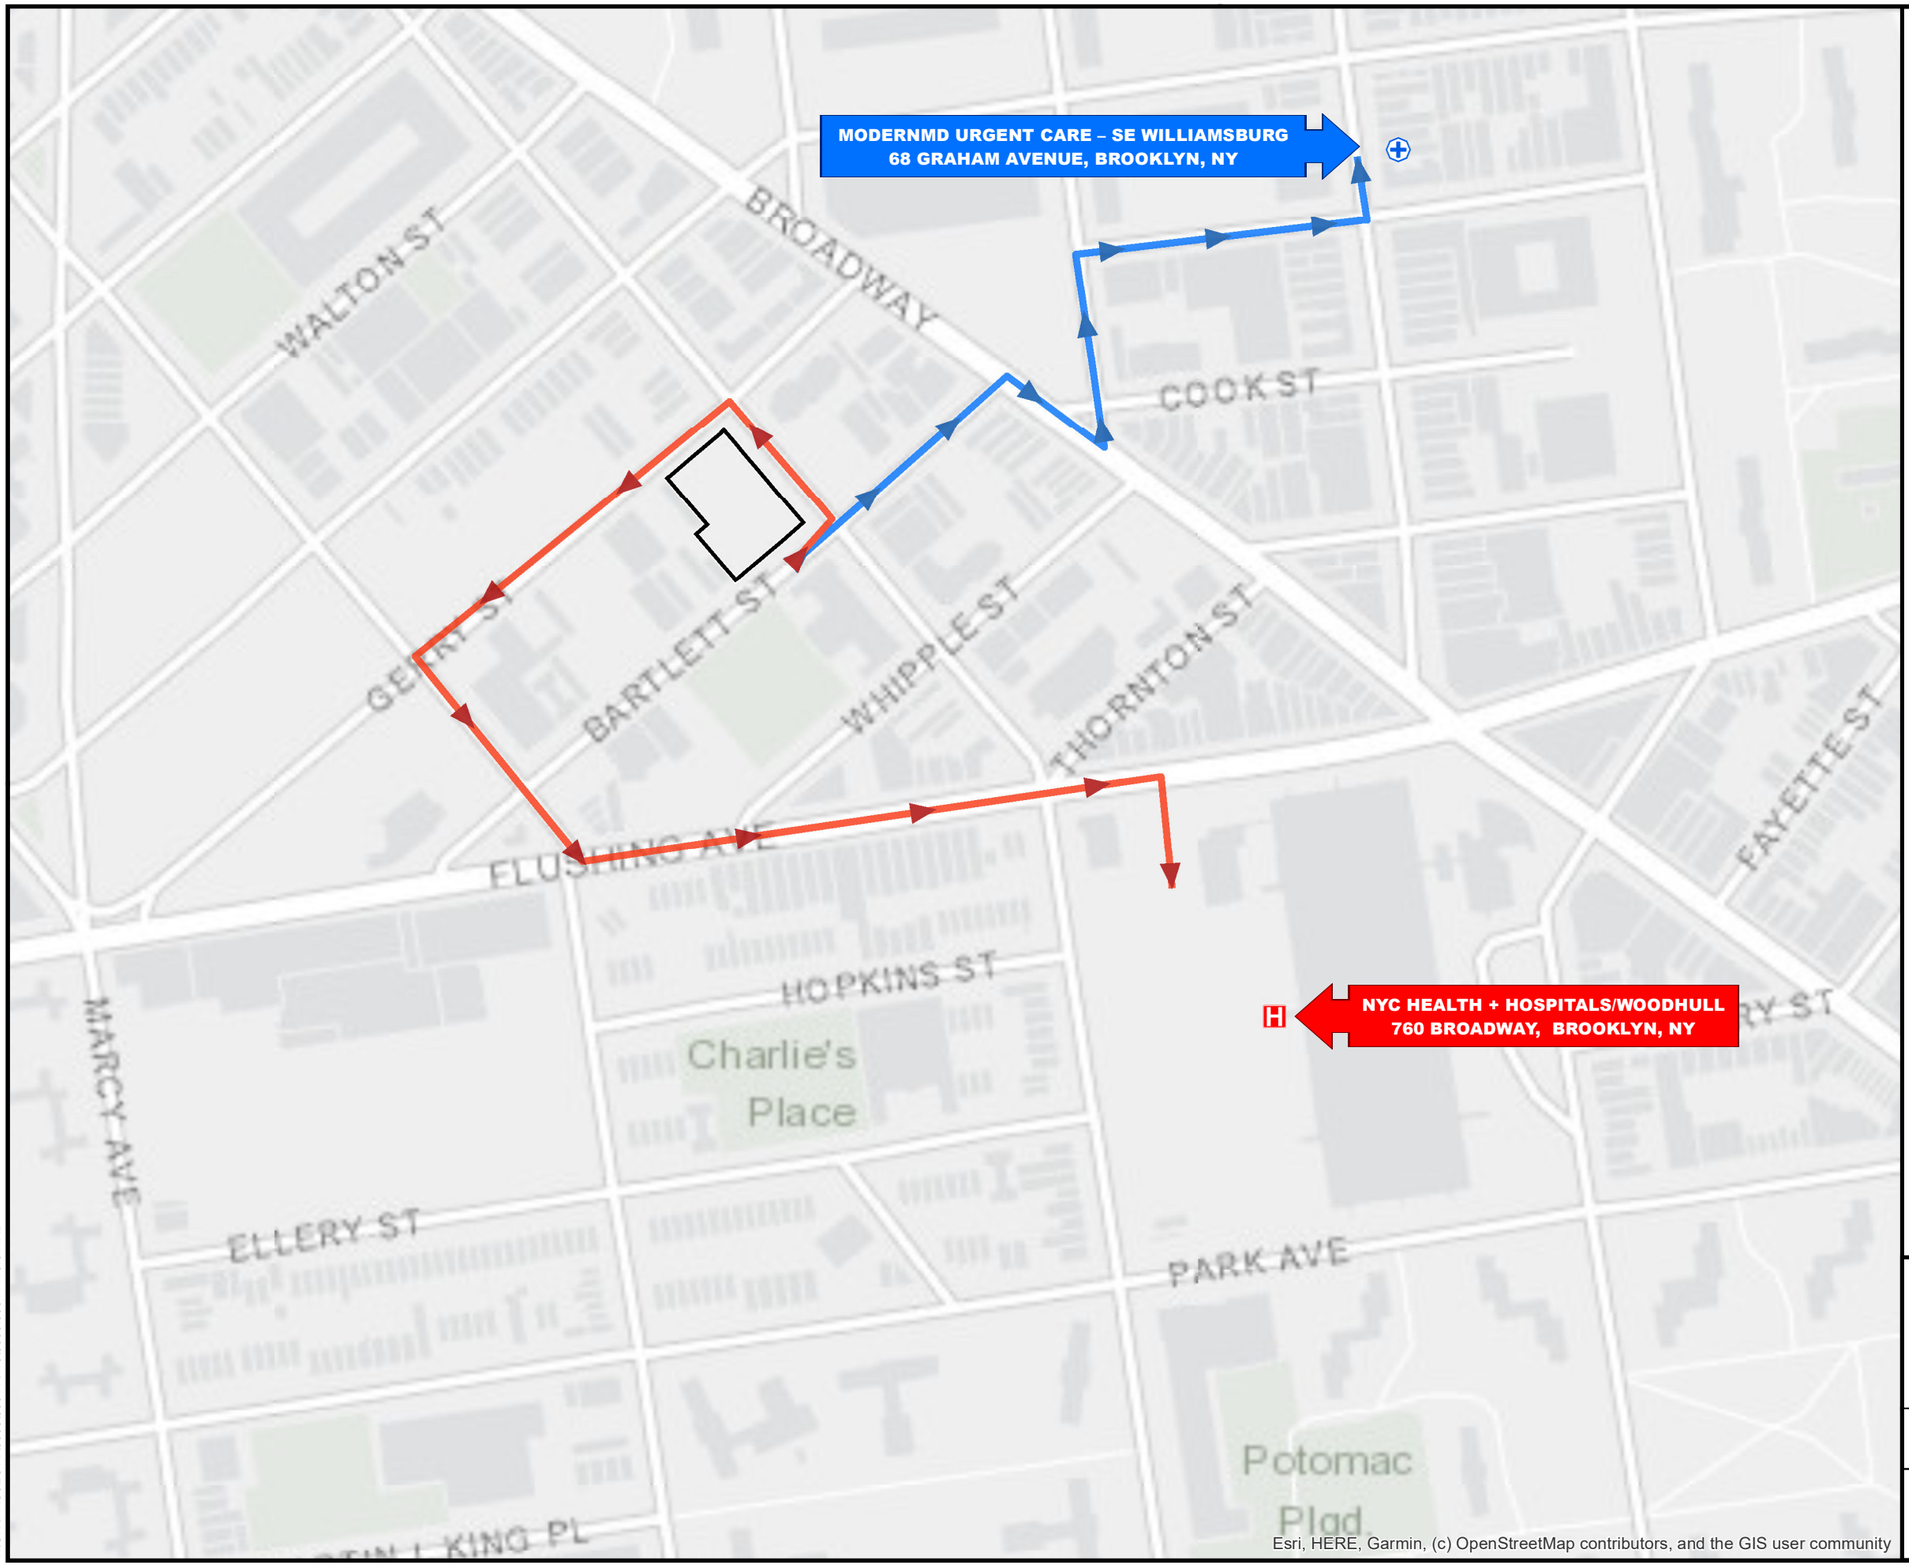

Esri, HERE, Garmin, (c) OpenStreetMap contributors, and the GIS user community

N

LEGEND

- HOSPITAL
- URGENT CARE
- ROUTE TO HOSPITAL
- ROUTE TO URGENT CARE

250 0 250'

Title:

ROUTES TO URGENT CARE AND HOPSITAL

BROADWAY TRIANGLE PARCEL C - THROOP CORNERS
59-69 BARTLETT ST, 84-100 THROOP AVE
AND 90-100 GERRY ST, BROOKLYN NY

Prepared for:

UNIFIED NEIGHBORHOOD PARTNERS LLC

ROUX

Compiled by: K.M.	Date: 03/05/21	FIGURE
Prepared by: M.S.R.	Scale: AS SHOWN	3
Project Mgr: B.V.	Project: 3065.0001Y000	
File: 3605.0001Y113.3.mxd		

V:\GIS\PROJECTS\3605\0001Y113\3605.0001Y113.3.MXD

APPENDICES

A. Job Safety Analysis (JSA) Forms
B. SDSs for Chemicals Used
C. COVID-19 Interim Health and Safety Guidance
D. Personal Protective Equipment (PPE) Management Program
E. Subsurface Utility Clearance Management Program
F. Heavy Equipment Exclusion Zone Policy
G. Incident Investigation and Reporting Management Program

APPENDIX A

Job Safety Analysis (JSA) Forms

JOB SAFETY ANALYSIS	Ctrl. No. CVD-19	DATE: 04/16/2020	☒ NEW ☐ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
Generic	**Fieldwork**	**Working in Areas Affected by Coronavirus**

DEVELOPMENT TEAM	POSITION / TITLE	REVIEWED BY:	POSITION / TITLE
Kristina DeLuca	Health and Safety Specialist	Brian Hobbs	CHSM

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT – In field ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES – In field	☐ GOGGLES ☐ FACE SHIELD ☐ HEARING PROTECTION ☒ SAFETY SHOES – Steel/composite toe in fie	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING – High visibility vest in field	☒ GLOVES – Leather/cut-resistant in field and nitrile as needed ☐ OTHER

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Cloth face covering, nitrile gloves, hand soap, water source, hand sanitizer, disinfectant spray and disinfectant wipes.

Commitment to Safety – All personnel onsite will actively participate in SPSA performance by verbalizing SPSAs throughout the day.

SOCIAL DISTANCING: Maintain 6' of distance between yourself and all other people at all times. If you do not believe the scope of work can be conducted while maintaining this distance, contact your Project Manager immediately.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Project Preplanning	N/A	• Review and follow COVID-19 CDC, Roux, Client and local orders/protocols. • Ensure all workers are fit for duty - anyone feeling sick should remain at home even if symptoms do not align with COVID-19. If a worker has been in contact with someone potentially positive or positive for COVID-19, contact your Office Manager. • Determine PPE needs and ensure adequate supply of disinfectant wipes/spray, soap and water or hand sanitizer at Site. Due to high demands and limited supply, plan ahead. • Use the minimum number of employees necessary to safely complete the work.
2. Mobilization	**Exposure:** Becoming infected or infecting co-workers	**Personal/Rental/Roux Owned Vehicle** • Do not carpool. • Use the same vehicle every day and do not share with co-workers. • Verify workers/other people are not approaching vehicle prior to exiting the vehicle. Maintain 6' of distance from others. • DO not valet your car or allow others to use your car. If necessary, don nitrile gloves and safety glasses and clean/disinfect all high touch surfaces (steering wheel, knobs, door handles, turn signals, radio, etc.) by wiping thoroughly with approved disinfectants (follow manufacturer's instructions). This cleaning and disinfection shall occur before and after each use of the vehicle. Aseptically remove gloves and dispose of them along with rags/wipes, appropriately. Wash hands or use hand sanitizer immediately after each episode of cleaning. **Public Transportation** • Public transit should not be used unless absolutely necessary. Consider renting a car rather than taking public transit. If public transit is required, wear appropriate PPE and apply social distancing (6 ft). Use proper donning and doffing procedures for nitrile gloves. Wash hands or use hand sanitizer immediately after. **Hotel Stay (Refer to COVID-19 H&S Guidance for more info)** • If a hotel stay is deemed necessary for the given field work, ensure that you disinfect your room upon initial arrival and returning each day. Disinfect all surfaces of your room with an appropriate disinfectant using nitrile gloves. Use proper donning and doffing procedures for nitrile gloves. • Place the "Do Not Disturb" placard on the room while away and limit housekeeping services to the extent feasible during your stay to minimize the reintroduction and spread of the virus from others. Minimize, or avoid entirely, time spent in hotel common areas (i.e., the lobby, dining areas, gyms, etc.). Wash hands or use hand sanitizer often.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards, energy source; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

3. Tailgate Meeting	**Exposure:** Becoming infected or infecting co-workers	• Must occur outside or remotely (i.e. video or conference call). • Maintain at least a 6+ ft distance between you and others. • Discuss primary infection prevention measures listed below. • Do not require employees or subcontractors to sign in, the Site Supervisor shall record names on the attendance form. • If the Site has more than 10 workers, separate tailgate meetings should be performed. • Discuss COVID-19 symptoms with coworkers and subcontractors to ensure fitness for duty. Anyone exhibiting signs or symptoms should be instructed to leave the Site, contact your Project Manager.
4. Site Activities	**Exposure:** Becoming infected or infecting co-workers	• Coordinate field activities at the beginning of the day (i.e. Tailgate meeting) to minimize time spent in crowded spaces or overlap while completing job tasks. • Don cloth face coverings as appropriate. • Apply social distancing (6+ ft) when interacting with others. If anyone comes within 6 ft of you while conducting work and your work prevents you from moving away, politely ask them to move back. If others are unable to move from your space, stop work and leave area. • Do not shake hands or touch others. • Do not share equipment or other items with co-workers and subcontractors unless wearing appropriate PPE (e.g. nitrile gloves). Assume equipment and other surfaces are potentially contaminated and remove gloves aseptically (See Appendix A of Roux Interim H&S Guidance for proper glove removal). • If anyone is coughing or sneezing in your vicinity, stop work and leave the area. • Do not work in areas with limited ventilation with others. • Cover your mouth and nose with tissue or paper towel or with your elbow when coughing or sneezing and wash hands or use hand sanitizer immediately after. If sick contact SHSO/PM and leave Site immediately. • Disinfect work surfaces/areas with approved disinfectant you're responsible for (ex: desk, office doorknob, computer, etc.) at least once at the beginning of your shift and at least once at the end of your shift with either sanitizing wipes or disinfectant spray. • Phones should be operated hands free to extent feasible. Sanitize your phone on a regular basis. Disinfection should also take place whenever suspected contaminated material comes in contact with any work surfaces/areas. Wash hands or use hand sanitizer immediately after. • Avoid public spaces and going out to eat by bringing your own lunch to the Site. If performing work in high density urban areas, it is recommended all food must be consumed at or in your vehicle. Wash hands or use hand sanitizer before eating and immediately after.

Primary Infection Prevention Measures

- Wash your hands often with soap and water for at least 20 seconds.
  - If soap and water are not available, use an alcohol-based sanitizer that contains at least 60% ethanol or 70% isopropanol. Key times to wash hands include after blowing your nose, coughing or sneezing, after using the restroom, and before eating or preparing food.
- Do not touch your eyes, face, nose and mouth with unwashed hands.
- Cover your mouth and nose with a tissue when you cough or sneeze or use the inside of your elbow. Throw potentially contaminated items (e.g. used tissues) in the trash.
- Avoid close contact/secondary contact with people and potentially contaminated surfaces.
  - Apply appropriate social distance (6+ feet).
  - Stop handshaking/touching others and use caution when accessing public spaces.
- Clean and disinfect frequently touched surfaces daily. Commonly touched items can include but are not limited to tables, doorknobs, light switches, countertops, handles, desks, phones, keyboard, toilets, sinks and field equipment. If surfaces are dirty, they should be cleaned with soap and water prior to disinfection. If surface cannot be cleaned/disinfected, then wash hands or use sanitizer as soon as possible.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy source – electricity, pressure, compression/tension.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-003	DATE 7/10/2020	☐ NEW ☒ REVISED	PAGE 1 of 2
JSA TYPE CATEGORY **GENERIC**	WORK TYPE **Construction - Excavation**	WORK ACTIVITY (Description) **Backfilling Excavation & Compaction**		

DEVELOPMENT TEAM	POSITION / TITLE	REVIEWED BY:	POSITION / TITLE
David Kaiser	Project Engineer	Brian Hobbs	Corporate Health & Safety Manager
Edward Lacina	Senior Construction Manager		

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST	☐ GOGGLES	☐ AIR PURIFYING RESPIRATOR	☒ GLOVES: Leather/ cut-resistant level 2
☒ HARD HAT	☐ FACE SHIELD	☐ SUPPLIED RESPIRATOR	☐ OTHER _____
☐ LIFELINE / BODY HARNESS	☒ HEARING PROTECTION	☒ PPE CLOTHING: reflective DOT approved safety	
☒ SAFETY GLASSES	☒ SAFETY TOE BOOTS		

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Payloader, Backhoe, Dump Trucks, Mechanical gas powered tampers, Excavator with hydraulic tamper. APR when tamping if dust present. Two-way radios.

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs.

EXCLUSION ZONE (EZ): Maintain Minimum Heavy Equipment Exclusion Zone (HEEZ) around equipment and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, tip zone of the equipment, fall zone of the equipment and contents, distance that debris may travel during demolition activities and/or foot print of a structure to be demolished.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Pre-construction meeting: Review proposed excavation locations	**1a. CONTACT:** Potential for contact with subsurface utilities and above ground utilities	1a. Call state 811 for mark out service and one call ticket. 1a. Obtain private utility mark out service as necessary. 1a. Review and mark proposed excavations w/white paint. 1a. Identify all "Critical" zones. A Critical zone is any area within 10 feet of any operating utility. 1a. **Complete subsurface clearance checklist.** 1a. Soft dig must be conducted within 2 lateral feet of any suspected underground utility. 1a. Protection of aboveground utilities identified as being located within the work zone must be coordinated w/ client and utility owner.
2. Secure Work Area	**2a. CONTACT:** Potential for personnel to enter the work area. Potential for equipment to contact, or crush personnel. **2b. EXERTION:** Potential for muscle strain or tear while installing traffic cones and barrel	2a. Ensure work area is secure and inform others of work activity. Establish a HEEZ using 42" traffic cones, barrels & snow fencing or telescoping poles. Use of flag persons to maintain clear traffic and to minimize motorist confusion during set-up of new traffic pattern. HEEZ to include tip/swing radius of equipment. 2a. Dump Truck/Excavator/Payloader/Backhoe equipment to be set-up by personnel who are familiar with machinery. Spotters shall be in place for all equipment. and to control access to the HEEZ 2a. Truck wheels are chocked when driver is not in truck and engine shut off. 2a. Personnel shall stay out of the exclusion zone (10' minimum or greater than the equipment boom) while equipment is maneuvering. 2b. Keep back straight, keep load close to the body and bend knees while lifting and working. If over 50 lbs., use 2 or more laborers for lifting or use of equipment.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

3. Backfilling excavation, and compaction	**3a. CONTACT:** Traffic and live equipment. .	3a. Equipment and trucks shall be isolated from other workers, subcontractors and third party traffic with 42" traffic cones, barricades, snow fencing or telescoping poles, and/or Jersey barriers. Spotters shall direct dump truck for placement of fill near excavation. Pay loader/ Excavator, as directed by spotter, shall move fill into trench where it shall be placed in layers and compacted by mechanical means. 3a. Spotters will wear florescent vests at all times. 3a. Spotters will remain out of the exclusion zone, line of fire from equipment and third-party vehicles. 3a. Spotters and operators will have radios for communication, when other visual and/or hand signals are insufficient. 3a. Locate all overhead utilities. All personnel and machinery should maintain a 10' distance from overhead electric lines. Refer to OSHA chart for distances and voltage. 3a. For excavations engineered (shored, sloped, benched} all personnel, equipment, and materials must remain a minimum of 2 feet from edge of excavation.
	3b. EXPOSURE: Fumes from gas powered tamper	3b. Fueling of all equipment will be done outside of work area in a well-ventilated area. Refueling will be done only after a 2-5-minute cool down.
	3c. FALL: Slips, trips, fall hazards.	3c. Work area will be clean and free of any debris to remove slip, trip and fall hazards. All tools will be kept in designated areas. Insure work area is well illuminated. 3c. Workers should only be working in areas that have been leveled with a machine. 3c. All persons working at elevations over 6' shall use a guardrail system or personal fall arrest system while around excavation.
	3d. OVEREXERTION: Muscle strain, or tear.	3d. Keep knees bent and back straight while transferring/ lifting/lowering tamper from elevated areas. Utilize a co-worker to avoid staining muscles. 3d. Keep knees bent and back straight while maneuvering tamper. Utilize a co-worker to avoid staining muscles.
	3e. EXPOSURE: Noise from tamper. Dust inhalation.	3e. Workers will wear hearing protection during compaction tamper activities. 3e. Wear NIOSH approved dust mask for personal comfort. If dust is visible for extended time, limit by wetting down area. 3e. If dust continues stop work and evaluate if APR is needed with approval and clearance.
4. Secure/leave site.	**4a. FALL:** Slip, trip, fall	4a. Clear work area of all debris and store all equipment in designated areas/containers before opening to traffic. 4a. Replace fencing and barricades as needed to secure path before opening roadway or area up to traffic(vehicle, pedestrian and/or bicycle).

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-005	DATE 7/10/2020	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
GENERIC	**Construction**	**Cutting with Gas-powered Saw, Sawzall or Plasma Cutter**

DEVELOPMENT TEAM	POSITION / TITLE	REVIEWED BY:	POSITION / TITLE
Ray Greenidge	Office Health and Safety Manager	Brian Hobbs	Corporate Health & Safety Manager

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☒ REFLECTIVE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☐ GOGGLES ☒ FACE SHIELD (gas powered saw and plasma cutter) ☒ HEARING PROTECTION ☒ SAFETY SHOES: Steel-toed boots	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: Fluorescent Long sleeved shirt and / or reflective safety vest	☒ GLOVES: Cut-resistant, leather, nitrile ☒ OTHER: Chaps for gas powered saw. Welding suit for plasma cutting.

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Sawzall/extension cord

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Set up/ Secure work area.	**1a. CONTACT:** Personnel could enter the work area	1a. Establish the work zone using 42" cones, caution tape, or fixed rigid barrier. Inform others of work activity.
2. Precutting procedure.	**2a. CONTACT:** Improper blade, malfunctioning guards, unsecured materials, flying debris	2a. Inspect all equipment for defects, replace or service if not functioning optimally. Check that all guards are working and in place, replace if missing. Ensure that blades are sharp and clean to avoid binding and/or burning. Cut on flat/secure work surfaces. Do not cut badly warped wood or boards with knots or nails. 2a. Unplug saw before handing it off to another person. 2a. Wear safety glasses, long-sleeved shirt and leather gloves. Utilize job specific PPE such as welding jacket or chaps when using gas powered saw or a plasma cutter.
	2b. EXPOSURE: Loud noises, dust, bright UV light	2b. When using gas powered saw, wet down area to be cut prior to cutting if high dust levels are anticipated. 2b. Wear hearing protection. Wear a dust mask if large amounts of dust are expected; cut upwind if possible. 2b. When plasma cutting, wear a face shield with shaded glasses rated to block UV light generated by the plasma cutter.
	2c. ENERGY SOURCE: Potential for electric shock	2c. Inspect extension cord for damage. If damaged, tag out and repair / replace. Do not operate saw while standing in water. Ensure GFCI protection at outlet or via attachment. 2c. Ensure all electrical equipment is rated for the task.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
3. Saw Cutting.	**3a. CONTACT:** Fingers could be cut, lacerated or amputated by reciprocating blade; also flying debris and sparks	3a. Cut away from body. Keep fingers away from moving blade. No loose clothing. Never leave saw running unattended. Unplug saw before changing blades or making adjustments / repairs. Set-up barrier to contain sparks. Cut on flat/secure work surfaces. 3a. Wear Safety glasses 3a. Ensure that the saw blade stops rotating/reciprocating before placing saw on the ground.
	3b. CONTACT: Amputation and line of fire injury.	3b. Maintain a minimum 15-foot exclusion zone and ensure that operator and other personnel are kept out of the line-of- fire of the equipment.
	3c. FALL: Tripping hazards caused by cutting/grinding debris, extension cords.	3c. Keep debris generated in designated storage containers. Keep work area free of Slip, Trip and Fall hazards. 3c. Do not route extension cords through walking/working path.
	3d. EXERTION/ERGONOMICS: Lifting heavy or awkward materials may cause muscle strain.	3d. Maintain Proper Body Position while operating lifting and moving with equipment. Keep load close to body, knees bent, and back straight. 3d. Take frequent breaks or switch personnel if cutting for an extended period of time.
	3e. EXPOSURE: Personnel may be exposed to fire hazard during Hot Work Activities.	3e. Complete Hot Work Permit, Designate Fire Watch. 3e. Conduct work zone inspection: – Verify that all combustible or flammable materials or equipment fuel sources have been removed from within 35 feet of the proposed hot work. – If combustible or flammable materials or equipment fuel sources have not been removed from within 35 feet of the hot work, verify that engineering and procedural controls have been emplaced: curtains, blankets, wetting, ventilation. 3e. Two 20-lb. Type ABC Fire extinguishers required. 3e. Conduct continuous air monitoring / Lower Explosive Limit (LEL) screenings. Action Level: 10% of the LEL. 3e. If ambient air concentrations exceed LEL Action Levels, STOP WORK and contact supervisor. 3e. Wear hard hat, long sleeved-shirt and safety glasses. Utilize job specific PPE such as welding jacket or chaps and welding glasses when using gas powered saw or a plasma cutter.
4. Secure area when leaving tools unattended.	**4a. CONTACT:** Unauthorized personnel may enter the work area	4a. Unplug saw when not being used. Store equipment in designated storage areas when not being used.
	4b. FALL: Slip/trip/fall	4b. Store tool in designated storage location when it is not being used, secure all extension cords, keep all equipment out of walkways. 4b. Keep work area free of Slip, Trip and Fall Hazards.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-007	DATE 7/10/2020	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
GENERIC	**General Site Activity**	**Driving**

DEVELOPMENT TEAM	POSITION / TITLE	REVIEWED BY:	POSITION / TITLE
Valerie Sabatasso	Staff Scientist	Brian Hobbs	Corporate Health & Safety Manager

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT: when outside vehicle ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES:when outside vehicle	☐ GOGGLES ☐ FACE SHIELD ☒ HEARING PROTECTION ☒ SAFETY TOE BOOTS: when outside vehicle	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: high visibility vest, when outside vehicle	☒ GLOVES: Leather/ cut-resistant level 2 ☐ OTHER _____

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Motor Vehicle (i.e. car, truck, SUV)

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs

EXCLUSION ZONE (EZ): Maintain Minimum Heavy Equipment Exclusion Zone around equipment and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, tip zone of the equipment, fall zone of the equipment and contents, distance that debris may travel during demolition activities and/or foot print of a structure to be demolished.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Driving to/leaving Site	**1a. CONTACT:** Severe injury/disability, property damage, monetary loss (insurance premiums, deductibles, loss of license/job) caused by collision with or struck by other vehicles, obstructions, pedestrians, animals, etc. *Common factors that may lead to CONTACT incident, but not limited to: • distracted driving (cell phone, GPS, radio, billboards, "rubber necking") • lack of situational awareness • unfamiliarity with traffic patterns/road layout • weather conditions (wet/icy roads, hydroplaning, black ice) • weariness • high speeds • obstructed vision (solar glare, debris on windshield, blind spots) • changes in travel pathway (construction, snow banks, non-operational signals, potholes, detours, special events) • improper vehicle maintenance (non-operational signal light, worn tires, cracked windshield, ineffective wipers) • loose or unsecure objects	1a. PLAN AHEAD – review/make yourself familiar with maps and driving directions before beginning the drive to the Site. Do not attempt to drive and review maps/directions at the same time. Pull over and stop your vehicle before looking at maps/directions. 1a. Complete a basic vehicle inspection before driving. Verify Inspection and Registration are current, tires and wipers are in good condition, all lights are functional, all glass/mirrors are undamaged, the horn is functional, roof/hood/trunk are free from accumulated snow and visibility is not impaired due to snow/ice/frost/fog on windows. 1a. Do not hang items in car that can obstruct your view or become projectiles in a collision. 1a. Do not get distracted using touch screen radios or GPS units built into newer models. Keep your eyes on the road and stay alert. 1a. Follow posted speed limits and obey traffic signals and roadway signs. 1a. Always wear your seat belt and shoulder harness when driving. 1a. When driving around large vehicles and trucks, maintain extra space as these vehicles may not be able to see a smaller car too close. 1a. Follow the "Rules of the Road" including: using your turn signals, coming to a complete stop, and allowing vehicles the right of way (yield) when they are when traffic laws require. 1a. Apply the Smith Five Keys® of safe driving • Aim High in Steering® - Expand eye lead time to a minimum of 15 seconds • Get the Big Picture® - Maintain proper a 4 second minimum following distance at all times - Scan mirrors every 5-8 seconds to achieve a circle of awareness - Position your vehicle so you can see relevant/non-relevant objects • Keep Your Eyes Moving® - Try to maintain about 180 degrees of visibility - Avoid blank and fixed stares. Avoid focusing on one object for more than 2 seconds • Leave Yourself an Out® - Avoid traveling in traffic clusters - Surround yourself with space - Anticipate the actions of others

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Driving to/leaving Site (cont'd)	**1a. CONTACT:** Severe injury/disability, property damage, monetary loss (insurance premiums, deductibles, loss of license/job) caused by collision with or struck by other vehicles, obstructions, pedestrians, animals, etc.	• Make Sure They See You® - Maintain eye contact with on-coming vehicles/pedestrians - Use warning devices (e.g., hand signals, high-lights, horns etc.) - Proper timing is essential 1a. Do not perform reconnaissance or inspections while driving. Your vehicle should be parked in a safe location when viewing or surveying the Site and vicinity 1a. Avoid sudden turns and stops. Don't drive recklessly – be in control of vehicle at all times. 1a. In inclement weather, first determine if work can be POSTPONED. Otherwise, plan according to weather conditions including checking forecast along entirety of travel route (especially, for long distances). Reduce speed as road conditions warrant. Travelling with winter car equipment, in the winter, is strongly recommended (i.e., shovel, scraper, brush, blanket, extra clothing, flashlight, bag of sand). If your vehicle has 4-wheel drive, review to operators manual and understand operating procedure prior to engaging 4-wheel drive. If at any point on your drive weather becomes too severe to proceed safely pull over if safe to do so or seek nearest cover (e.g., overpass) 1a. If feeling drowsy or sleepy, do not drive. Pull over in a safe place to rest if you experience any signs of drowsiness. Make sure to get adequate sleep the night before an early drive. 1a. Never operate a vehicle under the influence of alcohol or illegal substances or medications affecting your performance. 1a. Keep your eyes on the road. Do not call or talk on cellular phones. Pull over to a safe location if you must answer or make a call. 1a. When parking, pull-through when possible. If backing is required visually inspect area to ensure it is free from obstructions prior to backing in and relying solely on mirrors; use spotters when available.
2. Entering/Exiting Vehicle.	**2a. CAUGHT:** Personal injury (broken fingers/hand) while entering or exiting vehicles **2b. FALL:** Personal injury (twisted ankle, deep contusion, concussion, broken wrist/arm, etc.) from slip/fall on uneven or unstable or slippery surface while exiting/entering vehicle **2c. CONTACT:** Severe injury/disability, property damage, monetary loss (insurance premiums, deductibles, loss of license/job) caused by collision with or struck by other vehicles, obstructions, pedestrians, animals, etc.	2a. Open and close doors slowly. Never put hands or feet in between door and vehicle to avoid pinch points. 2b. When exiting the vehicle make sure your feet are on firm footing and weight is evenly distributed before exiting/standing. In inclement weather use hands to support yourself, by holding the car door and/or steering wheel, when exiting the vehicle. 2c. Check both directions for traffic before opening door. Do not exit vehicle if traffic does not permit you to exit safely 2c. Check anticipated path of door prior to opening, do not open door into any obstructions (e.g., bollards, high curbing)

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-010	DATE 7/10/2020	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
Generic	**Surveying**	**Elevation Surveying**

DEVELOPMENT TEAM	POSITION / TITLE	REVIEWED BY:	POSITION / TITLE
Mark M Emmons	Project Engineer	Brian Hobbs	Corporate Health & Safety Manager
Bjorn Wespestad	Senior Engineer		
William Hansen	Senior Engineer		

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST	☐ GOGGLES	☐ AIR PURIFYING RESPIRATOR	☒ GLOVES: Cut-resistant or leather
☒ HARD HAT	☐ FACE SHIELD	☐ SUPPLIED RESPIRATOR	☒ OTHER: Long sleeve Shirt
☐ LIFELINE / BODY HARNESS	☐ HEARING PROTECTION	☒ PPE CLOTHING: Fluorescent reflective vest or high visibility clothing	
☒ SAFETY GLASSES	☒ SAFETY SHOES: Steel-toe boots		

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Surveying equipment (i.e., leveling rod/measuring ruler, tripod and autolevel).

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Check in with Site manager/ property owner.	**1a. CONTACT/EXPOSURE/FALL:** Lack of communication could result in H&S incident.	1a. Inform Site personnel of work scope, timeline and location(s). 1a. Inquire about other activities taking place at the Site. 1a. If applicable, obtain General Work permit for the day.
2. Locate surveying position for instrument and rod and set-up work area	**2a. FALL:** Slip/trip hazards	2a. Inspect area for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.) and obstructions prior to setting up at the survey location. Keep eyes engaged with walking surface while in movement. Remember "Walking is Working." 2a. Conduct housekeeping and maintain clear paths to walk in and remove debris as required.
	2b. CONTACT: Traffic (surveying locations could potentially be in parking areas and sidewalks)	2b. Be aware of oncoming traffic. Utilize a flagman / spotter for locations in streets or high-traffic areas. 2b. Place 42 inch cones around the work area and delineate work zone with caution tape, snow fencing or safety bars, if necessary. 2b. Wear appropriate PPE including long sleeve high visibility clothing and or reflective safety vest. 2b. Face traffic, maintain eye contact with oncoming vehicles and establish a safe exit route.
	2c. OVEREXERTION: Hazard due to carrying, lifting, and bending while transporting equipment	2c. Use proper body positioning and lifting techniques; keep back straight, lift with legs, keep load close to body, and never reach with a load. 2c. Avoid carrying too much equipment at one time and team-lift equipment that is more than 50 lb.
	2d. CAUGHT/CONTACT: Pinch Points / sharp edges associated with setting up the tripod	2d. Wear cut resistant gloves when handling the tripod and keep fingers away from pinch points located near moving parts of the tripod. Don't carry tripod by the pointed ends.
	2e. OVEREXERTION: Hazard due to bending awkwardly to look through the autolevel	2e. When practical, set the height of the autolevel optic as to minimize bending at the waist.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
3. Open / close manhole cover to well that is being surveyed (if necessary).	**3a. OVEREXERTION:** Muscle strain	3a. See 1c. Bend knees when reaching to open well. Use manhole lifting hook or pry bar to avoid bending.
	3b. CAUGHT: Pinch points associated with removing / replacing manholes and working with hand tools	3b. Wear leather gloves or cut resistant gloves when working with well cover and hand tools. 3b. Use proper tools (ratchet and crowbar or pry bar for well cover) and inspect before use. 3b. Do not put fingers under well cover.
	3c. EXPOSURE: To potentially hazardous vapors To biological hazards	3c. No open flames/heat sources. 3c. To minimize exposure to vapors, allow well to vent after opening it and before survey activities begin. 3c. Work on the upwind side of manhole/well. 3.c Use caution while opening lids to inspect work area for bees and insects inside of covers. 3c. Use insect/tick repellent as necessary.
	3d. CONTACT: With traffic	3d. See 2b.
4. Perform survey.	**4a. FALL:** Slip/trip hazards	4a. See 2a.
	4b. CONTACT: Traffic (surveying locations could be potentially located in parking areas and sidewalks)	4b. See 2b. 4b. Personnel using the scope will be devoting most of their attention to the surveying activity and shall be aware of vehicular and pedestrian traffic. Personnel holding the measuring stick should be extra vigilant of survey personnel and communicate any potential hazards to the instrument person via handheld radio or similar means. Ensure reflective safety vest is worn.
	4c. ENERGY SOURCES: Electrical shock from survey rod striking overhead electric lines or lights	4c. Prior to raising and extending the survey rod, personnel should thoroughly inspect the area above the measuring point. If overhead electrical lines are encountered within 20 feet of the measuring point; stop work and consult with the office health and safety officer.
5. Break down work area.	**5a. CONTACT:** Traffic (surveying locations can potentially be in parking areas and sidewalks)	5a. See 2b.
	5b. EXERTION: Hazard due to carrying, lifting, and bending while transporting equipment	5b. See 2c.
	5c. CONTACT: Personal injury or equipment damage by striking surroundings with an extended rod or unsecured tripod leg	5c. Ensure rod is entirely collapsed prior to mobilization / demobilization between survey points. 5c. Ensure tripod legs are fully collapsed and secured with strap prior to mobilization / demobilization between set-ups.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-011	DATE: 7/10/2020	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
Generic	**Construction - Excavation**	**Excavation / Trenching**

DEVELOPMENT TEAM	POSITION / TITLE	REVIEWED BY:	POSITION / TITLE
David Kaiser	Senior Engineer	Brian Hobbs	Corporate Health & Safety Manager
Ian Holst	Senior Engineer		

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST	☐ GOGGLES	☐ AIR PURIFYING RESPIRATOR	☒ GLOVES: Leather or cut resistant
☒ HARD HAT	☐ FACE SHIELD	☐ SUPPLIED RESPIRATOR	☐ OTHER
☒ LONG SLEEVED SHIRT	☒ HEARING PROTECTION	☒ PPE CLOTHING: Fluorescent reflective vest or high visibility long sleeved clothing	
☐ LIFELINE / BODY HARNESS	☒ SAFETY SHOES: Steel-toe boots		
☒ SAFETY GLASSES			

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Jackhammer, Excavator, Backhoe, Hand Tools, Photoionization Detector, barrels, 42" traffic cones, snow fencing, telescoping poles, temporary chain link fence, ladders, shovels, digging bars, power tools (cut-off saw), Two-way radios, Sheeting, Trench box, Retractable lanyard, Harness

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs

EXCLUSION ZONE (EZ): Maintain Minimum Heavy Equipment Exclusion Zone around equipment and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, tip zone of the equipment, fall zone of the equipment and contents, distance that debris may travel during demolition activities and/or footprint of a structure to be demolished.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Pre-Clearance Protocol.	**1a. CONTACT:** Damage to underground utility.	1a. Confirm that (if applicable) "Call Before You Dig" and local utility companies were contacted prior to trenching in order to confirm utility mark outs. Must have a case # before digging.
	1b. ENERGY SOURCE/CONTACT: Property damage; Pressurized water mains may cause lacerations or broken bones. Pressurized gas mains may explode causing serious injury, or death. Underground electric may cause severe burns, shock, or death.	1b. Pre-clearing of the trenching location must be conducted to a minimum of 5 vertical feet below the ground surface (10 feet minimum for Critical Zone) using hand tools (shovel and non-metallic dig bar) prior to trenching. Supervisor should be contacted to discuss appropriate pre-clearing depth. **1b. Complete subsurface clearance checklist**.
	1c. FALL: Slip, Trip or Fall may cause muscle strains or tears, abrasions, lacerations, or broken bones.	1c. Be aware of the conditions when walking or loading equipment and working. Walk within established pathway avoiding uneven surfaces. Remove potential slip/trip/fall hazards.
2. Set up work zone.	**2a. CONTACT/CAUGHT:** Cuts/lacerations from equipment. Broken bones from contact by vehicle.	2a. Isolate work area from hazards with cones, barricades, and snow fencing, telescoping poles or temporary chain link fence. Utilize a flag person when necessary (i.e., third party traffic in area). Install traffic signs in roadways and for detours. Spotters will maintain and enforce exclusion zone.
	2b. FALL: Slip, Trip or Fall may cause muscle strains or tears, abrasions, lacerations, or broken bones.	2b. See 1c.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards, energy source; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
3. Trenching Activity.	**3a. CONTACT:** Serious injury including broken bones, muscle strains or tears, and possibly death due to contact with machine.	3a. Spotter(s) required for all heavy equipment operation. No worker shall be allowed inside the exclusion zone or along the trench/excavation area while any equipment is in operation. A minimum exclusion zone greater than the length of the equipment boom must be established. Workers only allowed in exclusion zone if the operator is in "Hands Off "mode. Operator will not operate equipment until worker is out of exclusion zone. Spotters and operators will have radios for communication, when either loses sight of one another, and/or in case of emergency.
	3b. FALL: Slip, Trip or Fall may cause muscle strains or tears, abrasions, lacerations, or broken bones	3b. Any trench/excavation deeper than 3' must have a ladder within 25' of any worker in the excavation. At least 3'(rungs) of the ladder shall be above the top of the excavation. All spoil piles shall be maintained 2' minimum from edge of excavation. 3b. Any trench/excavation deeper than 6' must have fall protection, retractable lanyard for ladder use, and 42" high guardrails along the edge of the trench/excavation.
	3c. EXPOSURE: Noise, Dust, Concrete- Asphalt, petroleum hydrocarbon vapors may cause damage to ears and lungs	3c. Air monitoring using a calibrated photoionization detector (PID) will be used to monitor the breathing zone of the work area. If a reading of >5ppm is recorded, the oversight personnel must temporarily cease work and instruct all Site personnel to step away from the area of elevated readings.
4. Setting Trench protections if necessary.	**4a. CAUGHT:** Injury due to contact with failed trench, may include muscle strains or tears, abrasions or lacerations, broken bones and possibly death.	4a. To prevent cave-ins and avoid caught by/between, excavations over 4' in depth, unless working in stable rock, shall have engineer approved shoring, sheeting or trench box. Top of protection shall be at least 2' above top of excavation.
	4b. CONTACT/CAUGHT: Injury due to rigging activities and entering exclusion zone during lifting and/or transport of shoring/trench box/material may include muscle strains or tears, abrasions or lacerations, broken bones and possibly death.	4b. Use only inspected rigging with 2, 3 or 4 lift points; wear cut-resistant gloves. Rigging to be hooked up to factory installed hook up points on equipment. Control load with non-conductive tag lines with workers out of exclusion zone. Don't stand underneath suspended load; wear steel toed boots and hard hat.
	4c. FALL: Possible injury due to fall into excavation may include muscle strains or tears, abrasions or lacerations, or broken bones.	4c. Shoring to be set and sides will be backfilled to avoid fall hazards before workers are allowed to enter area. Operator will be in "HANDS OFF" mode before workers enter work area to unhook rigging. An inspected ladder extending 3' above top of the shoring will be used to enter and exit the shoring. Workers will use three points of contact when using the ladder.
5. Secure/Leave Site. If backfilling, see excavation backfilling and compaction JSA for potential hazards and critical actions.	**5a. FALL:** Potential Slip, Trip or Fall - may cause muscle strains or tears, abrasions or lacerations, or broken bones.	5a. See 1c. 5a. All open excavations must be backfilled or secured prior to departure with steel plates, orange construction fence or temporary chain link fencing.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-019	DATE: 7/10/2020	☐NEW ☒REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
GENERIC	**Site Recon**	**Site Walk and Inspection**

DEVELOPMENT TEAM	POSITION / TITLE	REVIEWED BY:	POSITION / TITLE
Sara Barrientos	Staff Geologist	Brian Hobbs	Corporate Health and Safety Manager
		Joe Duminuco	Vice President

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☐ GOGGLES ☐ FACE SHIELD ☒ HEARING PROTECTION: ear plugs as necessary ☒ SAFETY SHOES: Steel or composite toed	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: High-visibility vest or high-vis outerwear	☒ GLOVES: Leather/cut-resistant/chemical resistant ☒ OTHER: Tyvek and rubber boots as necessary, dust mask as necessary

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Required Equipment: Site map, emergency contact list, documentation of urgent care/hospital routes and / or guide familiar with Site, operating cell phone or walkie-talkie if Site allows.

Commitment to Safety – All personnel onsite will actively participate in SPSA performance by verbalizing SPSAs throughout the day.

EXCLUSION ZONE (EZ): Maintain Minimum Heavy Equipment Exclusion Zone around equipment and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, tip zone of the equipment, fall zone of the equipment and contents, distance that debris may travel during demolition activities and/or foot print of a structure to be demolished.

SITE SECURITY: Prior to site inspection verify appropriate method to address Site Security concerns as it relates to potential criminal activity, homeless population, and/or isolation concerns. Work with the Project Principal and/or Project Manager to address appropriately.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Check in with Site contact.	**1a. CONTACT/EXPOSURE/FALL:** Personal injury caused by lack of site specific hazards.	1a. Inquire about hazards and other activities taking place at the Site. 1a. Inform Site contact of work scope, timeline and location(s). 1a. Discuss emergency evacuation procedures and muster points with Site contact.
2. Traversing the Site	**2a. CONTACT:** Property damage and personal injury caused by obstructions/vehicles or unauthorized personnel at remote Sites.	2a. All equipment must be stowed and secured prior to moving. 2a. Maintain speed limit as posted on-site. 2a. When possible drive on established roadways. 2a. Yield to all pedestrians. 2a. Use pull-through spots or back into parking spots. 2a. Don high visibility clothing/safety vest. If working at remote Site, add orange accessories during hunting season.
	2b. FALL: Uneven terrain and weather conditions. Overgrown shrubs and vines. Equipment in the work zone.	2b. Inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions prior to mobilizing equipment. 2b. When possible, use established pathways and walk on stable, secure ground. 2b. Communicate traversing hazards with others.
	2c. OVEREXERTION: Muscle strain while carrying equipment.	2c. When carrying equipment to/from work area, use proper lifting techniques; keep back straight, lift with legs, keep load close to body, never reach with a load. Ensure that loads are balanced to reduce the potential for muscle strain. Use mechanical assistance or make multiple trips to carry equipment.
	2d. EXPOSURE: Biological hazards – ticks; bees/wasps; poison ivy; insects; (Ticks are most active any time the temperature is above freezing, typically from March to November.)	2d. Inspect area to avoid contact with biological hazards. 2d. Ticks: • Treat outer clothing including pants, shirts, socks, boots and hats the evening before with Permethrin (allowing at least two hours before use). • Apply DEET to exposed skin before travelling to the Site and reapply after two hours. • Check for ticks during and after work. 2d. Bees: • Use bee spray as appropriate to deter/eliminate bees. • Protect exposed skin with insect repellent.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

	2e. EXPOSURE: Heat Stress & Cold Stress. Personal injury from working in inclement weather conditions.	2d. Poison Ivy: • Identify areas of poison ivy and spray with weed killer. Don Tyvek and rubber boots while traversing poison ivy areas. • If skin contacts poison ivy, wash skin thoroughly with soap and water. 2e. Wear sunscreen with SPF 15 or greater on exposed skin whenever 30 minutes or more of sun exposure is expected. 2e. Watch for heat stress symptoms (muscle cramping, exhaustion, dizziness, rapid and shallow breathing). Take breaks as needed. 2e. Watch for cold stress symptoms (severe shivering, slowing of body movement, weakness, stumbling or inability to walk, collapse). Take breaks as needed. 2e. Wear appropriate rain gear as needed. 2e. Take frequent breaks if tired, wet, or cold/hot. Drink water. 2e. If lightning is observed, wait 30 minutes after last thunder boom/lightning bolt in a sheltered location (car acceptable) before starting work again.
3. Walking near heavy equipment and machinery.	**3a. CONTACT:** Personal injury from Site and roadway traffic. Personal injury from flying debris **3b. OVEREXERTION:** Personal injury from lifting/moving/rotating equipment. **3c. EXPOSURE:** Hearing damage from noise generating equipment/processes. Inhalation/exposure to hazardous vapors and or dust. **3d. EXPOSURE:** Working in a remote area.	3a. See 2a. 3a. Maintain an exclusion zone of at least 10'-25' feet from all engaged equipment. 3a. Keep body parts out of the line of fire of pinch points. 3a. Wear appropriate PPE always. 3b. See 2c. 3c. Wear hearing protection if >85 dBA. (i.e. noise levels which require you to raise your voice to communicate) 3c. Always wear leather gloves when handling any tools or equipment. 3c. Always wear appropriate PPE based off chemicals present. 3d. Use the "buddy system" whenever possible. If working alone, contact PM upon arrival/departure, as well as during work activities prior to commencing work if applicable. 3d. Always carry a communication (i.e., cell phone, walkie-talkie) or directional (i.e., map, compass, etc.) device when traversing remote areas.
4. Working in adverse weather conditions.	**4a. EXPOSURE:** Heat Stress & Cold Stress. Personal injury from working in inclement weather conditions.	4a. Watch for heat stress symptoms (muscle cramping, exhaustion, dizziness, rapid and shallow breathing). Take breaks as needed. 4a. Watch for cold stress symptoms (severe shivering, slowing of body movement, weakness, stumbling or inability to walk, collapse). Take breaks as needed. 4a. Wear appropriate rain gear as needed. 4a. Take frequent breaks if tired, wet, or cold/hot. Drink water. 4a. If lightning is observed, wait 30 minutes after last thunder boom/lightning bolt in a sheltered location (car acceptable) before starting work again.
5. Departing Site.	**5a. EXPOSURE:** Exposure to unnecessary hazards should personnel believe Roux is on-Site during an emergency and conduct a search.	5a. Sign out or notify Site contact and Roux Project Manager of your departure.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-023	DATE: 7/10/2020	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)	
Generic	**Construction**	**Spotting Heavy Machinery**	
DEVELOPMENT TEAM	**POSITION / TITLE**	**REVIEWED BY:**	**POSITION / TITLE**
Levi Curnutte	Project Scientist	Brian Hobbs	Corporate Health & Safety Manager

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST	☐ GOGGLES	☐ Particulate Respirator	☒ GLOVES: Cut resistant / leather
☒ HARD HAT	☐ FACE SHIELD	☐ SUPPLIED RESPIRATOR	☐ OTHER:
☒ LONG SLEEVED SHIRT	☐ HEARING PROTECTION	☒ PPE CLOTHING: Fluorescent reflective clothing	
☐ LIFELINE / BODY HARNESS	☒ SAFETY SHOES: Steel-/Composite-toe boots/shoes		
☒ SAFETY GLASSES			

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Heavy Machinery (i.e. excavator, payloader, truck, forklift, etc.)

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs

EXCLUSION ZONE (EZ): Maintain Minimum Heavy Equipment Exclusion Zone around equipment and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, tip zone of the equipment, fall zone of the equipment and contents, distance that debris may travel during demolition activities and/or foot print of a structure to be demolished.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Prepare for machine activity.	**1a. CONTACT:** Obstructions in the work area may create contact hazards from machinery.	1a. Cordon off the work area with safety barrels/cones and a rigid barrier (snow fence, traffic bar, etc.). Communicate that only necessary personnel should be in the work area. Spotter and equipment operator shall enforce the **EZ.** Operator will not operate but shall remain in the hands-off mode while personnel are within the exclusion zone.
	1b. Fall : Slip/Trip/Fall	1b. Ensure that work area is flat, level and clear of any obstructions or debris before setting up work zone.
2. Spotting.	**2a. CONTACT:** Machine or load contact with personnel, property, or machinery.	2a. Discuss the specifics of the work with the operator and be clear about any hand signals that will be used. Clearly discuss the limits of the assigned work area and the machine's Exclusion Zone. Maintain Exclusion Zone. The Exclusion Zone shall be delineated by using 42-inch traffic cones/barrels and a fixed rigid barrier. 2a. The Minimum Heavy Equipment Exclusion zone is greater than the swing/tip radius of equipment. 2a. Both the spotter and equipment operators shall have 2-way radios/cellular devices on their persons to ensure audible communication in the event any changes or new hazards may arise. 2a. All workers should stay outside of the Exclusion Zone of all equipment unless operator is stopped and in "Hands Off" mode. **(This includes the spotter unless an exception has been established in the Site-specific JSA).** If the Exclusion Zone must be reduced due to work area restrictions then the spotter and operator shall enforce the reduced Exclusion Zone. 2a. Spotters must make eye contact with the machine operator or all movement ceases until visual contact can be reestablished. 2a. Spotter shall keep an eye out for any issues with the machine the operator may not see and communicate with other work crews and spotters on behalf of the operator. 2a. If the spotter needs to take a break, he must find a replacement before leaving or have the machine stop operations. **No heavy equipment shall operate without a spotter under any circumstances.** 2a. Wear fluorescent clothing/safety vest.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
	2b. FALL: Slip/Trip/Fall	2b. Look where walking to identify and avoid slip/trip/fall hazards. Avoid icy and/or wet surfaces. Remove obstacles if possible. 2b. Use designated walkways during spotting whenever possible.
	2c. CAUGHT: Caught between machinery and nearby objects.	2c. **Maintain Exclusion Zone.** Do not stand between large, loose or fixed objects or structures and the machinery while it is in motion. Keep in sight of operator at all times while being aware of surrounding structures.
	2d. EXPOSURE: Inhalation of exhaust from machinery.	2d. The spotter will position him/herself upwind of the working machinery, when possible. Spotter will also inform others working within the vicinity of the EZ of proper positioning, if applicable.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Cntrl. No. GEN-027	DATE: 11/3/2020	☒ NEW ☐ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
GENERIC	**Drilling**	**Pre-Drilling Clearance, Vactron and Air Knife**

DEVELOPMENT TEAM	POSITION / TITLE	REVIEWED BY:	POSITION / TITLE
Courtney Rempfer	Staff Scientist	Joseph Midwig	Office Health & Safety Manager
Sara Redding	Senior Hydrogeologist	Brian Hobbs	Corporate Health & Safety Manager

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☐ GOGGLES ☒ FACE SHIELD (While Air Knifing) ☒ HEARING PROTECTION (As needed) ☒ SAFETY SHOES: Composite toe or steel toe boots	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: Fluorescent reflective vest or high visibility clothing; long-sleeve shirt	☒ GLOVES: Leather, Nitrile, cut-resistant ☒ OTHER: Dusk mask, insect repellant, sunscreen (as needed)

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Vac-Truck or Vac Drum, Compressor, Jack Hammer, Air Knife. Circular Saw, Hand Tools, Dust Mask, Photoionization Detector, Multi Gas Meter, 42 inch safety cones and flags, Retractable Cone Bars, Caution Tape, 20 lb. Fire Extinguisher, "Work Area" Signs, Pressurized Water Sprayer

Commitment to Safety – All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs

EXCLUSION ZONE: All non-essential personnel will maintain a distance of 10 feet from drilling equipment while equipment is moving/engaged

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Verify pre-clearance protocol	**1a. CONTACT:** Underground utility damage; property damage; personal injury	1a. Confirm that (if applicable) "Call Before You Dig" and local utility companies were contacted prior to starting work in order to confirm utility mark outs. Must have a case # before digging. 1a Walk the Site to evaluate utility markings and review maps (see Site Walk Inspection JSA). Utilities are not always properly marked out ensure use of observational skills through the pre-clearing checklist. 1a. Review pre-clearing checklist fromm and sub-surface clearance form. Pre-clearing protocol indicates that clearance must be conducted to a minimum of 5 vertical feet below ground surface or 10 vertical feet below ground surface in the critical zone using hand tools.
	1b. ENERGY SOURCE/CONTACT: Property damage; Pressurized water mains may cause lacerations or broken bones. Pressurized gas mains may explode causing serious injury, or death. Underground electric may cause severe burns, shock, or death.	1b. Pre-clearing of each soil boring/monitoring well location must be conducted to a minimum of 5 vertical feet below the ground surface (10 feet minimum for Critical Zone) using hand tools (shovel and non-metallic dig bar and hand auger) prior to drilling. Supervisor should be contacted to discuss appropriate pre-clearing depth. 1b. MUST Complete subsurface clearance checklist prior to pre-clearance.
	1c. FALL: Slip, Trip or Fall may cause muscle strains or tears, abrasions, lacerations, or broken bones.	1c. Be aware of the conditions when walking or loading equipment and working. Walk within established pathway avoiding uneven surfaces. Remove potential slip/trip/fall hazards.
2. Mobilize/demobilize and establish work area	**2a. SEE MOBILIZATION / DEMOBILIZATION JSA**	2a. See Mobilization / Demobilization JSA
3. Concrete saw cutting, jack hammer and hand clearance with hand tools, air knife	**3a. CONTACT:** Flying debris striking face or body	3a Maintain 10' minimum exclusion zone. Use the required PPE (i.e., leather/cut proof gloves, safety glasses/face shield). 3a. Use anti-whip devices on compressor hoses. 3a Wear a face shield to protect face from flying debris when using air knife. 3a. Utilize a traffic cone or physical barriers over the hole during air knife activities to keep flying debris close to ground.
	3b. EXPOSURE: Inhalation/exposure to hazardous vapors and/or concrete dust, noise exposure	3b. Monitor breathing zone with a calibrated PID and/or multi-gas meter. If meters sustain readings greater than recommeneded in the HASP for the specific contaminant of concerns (COCs) the Roux field personnel must temporarily cease work, instruct all Site personnel to step away from the area of elevated readings. Contact PM. 3b. Wet concrete while using saw to minimize dust and wear dust mask to prevent inhalation. 3b. Stand upwind and keep body behind saw. Observers and helpers should avoid line of fire for saw blade. Always cut away from body. 3b. No open flames/heat sources. 3b. Wear hearing protection when saw, jackhammer or air compressor are in operation. Otherwise, if sound levels exceed 85 dbA, put on hearing protection.
	3c. ENERGY SOURCE/CONTACT: Property damage; Pressurized water	

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into five types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

	mains may cause lacerations or broken bones. Pressurized gas mains may explode causing serious injury, or death. Underground electric may cause severe burns, shock, or death.	3c. For air knifing, ensure extention/lance tip reaches the full 5 feet bgs. Air knife should be advanced **AT A MINIMUM** in all four corners of the expected boring location to find any possible arrangement of utilities. 3c. Ensure diameter of soil preclearance hole is at a **MINIMUM 2x** the diameter of any drilling or hard dig equipment that will be entering the hole. 3c. See Complete subsurface clearance protocol for information provided above.
	3d. ERGONOMICS/EXERTION: Muscle strain due to poor body positioning when handling equipment and materials	3d. Use body positioning and lifting techniques that minimizes muscle strain; keep back straight, lift with legs, keep load close to body, and never reach with a load. 3d. Ensure that loads are balanced to reduce the potential for muscle strain. 3d. Two people or a mechanical lifting aid are required when lifting objects over 50 lbs. or when the shape makes the object difficult to lift.
	3e. FALL: Tripping/falling due to uneven terrain, weather conditions, and materials/equipment stored at the Site	3e. Inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions prior to mobilizing equipment. Mob/Demob JSA. 3e. Do not climb over stored materials/equipment; walk around. Practice good housekeeping. 3e. Use established pathways and walk on stable, secure ground. 3e. Equipment and tools will be stored at the lowest point of potential energy and out of the walkway and immediate work area (i.e. tools should not be propped against walls or nearby equipment or vehicles). 3e. Equipment and tools that are not anticipated to be used will be returned to a storage area that is out of the immediate work area. 3e. Ensure power cords and compressed air lines are grouped when used within the work area. 3e. Pre-cleared location will be finished flush to grade as to prevent a slip/trip hazard or coned and taped off.
	3f. CAUGHT: Amputation points associated with the equipment and vacuum hose	3f. Always wear leather gloves when making connections and using hand tools; wear cut-resistant (i.e., Kevlar) gloves when handling cutting tools. 3f. Inspect the equipment prior to use for potential pinch points. 3f. Test all emergency shutdown devices prior to using equipment. 3f. Inspect saw blade for worn surface or missing teeth; switch blade if damaged or blunt. 3f. Ensure all jewelry is removed, loose clothing is secured, and PPE is secured close to the body. 3f. All non-essential personnel shall maintain a 10 foot exclusion zone; position body out of the line-of-fire of equipment. 3f. Drillers and helpers will understand and use the “Show Me Your Hands Policy”.
4. Move drum to staging area using drum cart	**4a. EXPOSURE/CONTACT:** Contamination (e.g., Separate Phase Hydrocarbons (SPH), contaminated groundwater, soil)	4a. Wear Nitrile chemical-resistant gloves under leather or cut proof gloves. 4a. Do not overfill drums. Ensure that the drum lids are attached securely. 4a. All drums will be staged in the designated storage area.
	4b. EXERTION: Muscle strain while maneuvering drums with drum cart/lift gate	4b. See 3d. Do not overfill drums. Use lift gate on back of truck to load and unload drums. Use drum dolly to move drum.
	4c. CAUGHT: Pinch points associated with handling drum lid	4c. Ensure that fingers are not placed under the lid of the drum. Wear leather gloves or cut proof gloves. Use appropriate ratchet while sealing drum lid.
5. Decontaminate equipment.	**5a. EXPOSURE/CONTACT**: To contamination (e.g., Separate Phase Hydrocarbons (SPH), contaminated groundwater, vapors).	5a. Wear chemical-resistant disposable gloves and safety glasses. 5a. Contain decontamination water so that it does not spill. 5a. Use an absorbent pad to clean spills, if necessary. 5a. Spray equipment from side angle, not straight on, to avoid backsplash. 5a. See 3b.
	5b. EXPOSURE: To chemicals in cleaning solution.	5b. See 4a. Review SDS to ensure appropriate precautions are taken and understood.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into five types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-006	DATE 7/10/2020	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY:	WORK TYPE:	WORK ACTIVITY (Description):	
Generic	**Drilling**	**Direct Push Soil Borings / Well Installation**	
DEVELOPMENT TEAM	**POSITION / TITLE**	**REVIEWED BY:**	**POSITION / TITLE**
Timothy Zei	Project Hydrogeologist	Raymond Olson	Office Health & Safety Manager
		Brian Hobbs	Corporate Health & Safety Manager

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☐ GOGGLES ☐ FACE SHIELD ☒ HEARING PROTECTION: (as needed) ☒ SAFETY SHOES: Composite-toe or steel toe boots	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: Fluorescent reflective vest or high visibility clothing, Long Sleeve Shirt	☒ GLOVES: Leather, Nitrile and cut resistant ☒ OTHER: Insect Repellant, sunscreen (as needed)

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Geoprobe or Truck-Mounted Direct Push Drill Rig, Hand Tools, Photoionization Detector, Multi-Gas Meter (or equivalent), Macrocore liners, Liner Opening Tool, 20 lb. Type ABC Fire Extinguisher, 42" Cones & Flags, "Work Area" Signs, Water

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs

EXCLUSION ZONE (EZ): Maintain Minimum Heavy Equipment Exclusion Zone around equipment and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, tip zone of the equipment, fall zone of the equipment and contents, distance that debris may travel during demolition activities and/or foot print of a structure to be demolished.

"SHOW ME YOUR HANDS"
Driller and helper should show that hands are clear from controls and moving parts

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Mobilization of drilling rig (ensure the Subsurface Clearance Protocol and Drill Rig Checklist are completed)	**1a. CONTACT:** Equipment/property damage.	1a. The drill rig's tower/derrick will be lowered and secured prior to mobilization. 1a. A spotter should be utilized while moving the drill rig. If personnel move into the path of the drill rig, the drill rig will be stopped until the path is again clear. Use a spotter for all required backing operations. 1a. Set-up the work area and position equipment in a manner that eliminates or reduces the need for backing of support trucks and trailers. 1a. When backing up truck rig with an attached trailer use a second spotter if there is tight clearance simultaneously on multiple sides of the equipment or if turning angles limit driver visibility. 1a. Inspect the driving path for uneven terrain. Level or avoid if needed. 1a. Drill rig should have a minimum **exclusion zone which encompasses its tip radius** for non-essential personnel (i.e., driller helper, geologist) when the rig is moving/ in operation.
	1b. FALL: Slip/trip/fall hazards.	1b. Inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions prior to mobilizing equipment. 1b. Do not climb over stored materials/equipment; walk around. Practice good housekeeping. 1b. Use established pathways and walk on stable, secure ground.
	1c. CONTACT: Crushing from roll-over.	1c Geoprobe should cross all hills/obstructions head on with the mast down to reduce risk of roll-over.
2. Raising tower/derrick of drill rig	**2a. CONTACT:** Overhead hazards.	2a. Prior to raising the tower/derrick, the area above the drilling rig will be inspected for wires, tree limbs, piping, or other structures, that could come in contact with the rig's tower and/or drilling rods or tools. 2a. Maintain a safe distance of 10' from overhead structures.
	2b. CONTACT: Pinch Points/Amputation Points when raising the rig and instability of rig	2b. Inspect the equipment prior to use and avoid pinch/amputation points. 2b. Lower outriggers to ensure stability prior to raising rig tower/derrick. 2b. If the rig needs to be mounted, be sure to use three points of contact.
3. Advancement of drilling equipment and well installation	**3a. CONTACT:** Flying debris	3a. Be aware of and avoid potential lines of fire and wear required PPE such as eye, ear, and hand protection.
	3b. EXPOSURE: Noise and dust.	3b. Wet borehole area with sprayer to minimize dust. 3b. Stand upwind and keep body away from rig. 3b. Dust mask should be worn if conditions warrant. 3b. Wear hearing protection when the drill rig is in operation.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
3. Advancement of drilling equipment and well installation (Continued)	**3a. CONTACT:** Flying debris **3b. EXPOSURE:** Noise and dust. **3c. FALL:** Slip/trip/fall hazards. **3d. CAUGHT:** Limb/extremity pinching; abrasion/crushing. **3e. CONTACT:** Equipment imbalance during advancement of drill equipment. **3f. EXPOSURE:** Inhalation of contamination/vapors. **3g. EXERTION:** Potential for muscle strain/injury while lifting and installing well casings, lifting sand bags, and/or lifting rods.	3c. Contain drill cuttings and drilling water to prevent fall hazards from developing in work area. 3c. See 1b. 3d. Ensure all Emergency Safety Stop buttons function properly. 3d. Always wear leather gloves when making connections and using hand tools; wear cut-resistant (i.e., Kevlar) gloves when handling cutting tools. 3d. Inspect the equipment prior to use for potential pinch/amputation points. Keep hands away from pinch/amputation points and use of tools is preferable compared to fingers and hands. 3d. Inspect drill head for worn surface or missing teeth; replace if damaged or blunt. 3d. Ensure all jewelry is removed, loose clothing is secured, and PPE is secured close to the body. 3d. All non-essential personnel should stay away from the immediate work area; position body out of the line-of-fire of equipment. 3d. Drillers and helpers will understand and use the "Show Me Your Hands" Policy. 3d. Spinning rods/casing have an **exclusion zone of tip radius** while in operation. 3e. Drillers will advance the borehole with caution to avoid causing the rig to become imbalanced and/or tip. 3e. The blocking and leveling devices used to secure the rig will be inspected by drillers and Roux personnel regularly to see if shifting has occurred. 3e. In addition, personnel and equipment that are non-essential to the advancement of the borehole will be positioned away from the rig at a distance that is at least as far as the boom is high (**minimum exclusion zone**). 3f. Monitor ambient air for dangerous conditions using a calibrated photoionization detector (PID) to periodically monitor the breathing zone of the work area. 3f. If a reading of >5ppm is recorded, the Roux field personnel must temporarily cease work, instruct all Site personnel to step away from the area of elevated readings and inform the Roux PM of the condition. The Roux PM will then recommend additional precautions in accordance with the site specific health and safety plan. 3f. Use a multi-gas meter to monitor ambient air for dangerous conditions (i.e. unsafe levels of carbon monoxide when drilling indoors or the presence of explosive vapors). 3g. Keep back straight and bend at the knees. 3g. Utilize team lifting for objects over 50lbs. 3g. Use mechanical lifting device for odd shaped objects.
4. Remove sample liner.	**4a. EXERTION:** Potential for muscle strain/injury while removing liner from probe rod. **4b. CONTACT:** Pinch points and cuts **4c. EXPOSURE:** Inhalation and/or dermal contact with contaminants.	4a Utilize team lifting for objects over 50lbs. 4a. Use hydraulic liner extruder if available. 4b. Place liner on sturdy surface when opening. 4b. Don cut-resistant gloves and use appropriate liner cutter when opening liners. 4b. Always cut away from the body. 4c. Wear chemical-resistant disposable gloves when handling liners. 4c. See 3e.
5. Decontaminate equipment.	**5a. EXPOSURE/CONTACT**: To contamination (e.g., Separate Phase Hydrocarbons (SPH), contaminated groundwater, vapors). **5b. EXPOSURE:** To chemicals in cleaning solution including ammonia.	5a. Wear chemical-resistant disposable gloves and safety glasses. 5a. Contain decontamination water so that it does not spill. 5a. Use an absorbent pad to clean spills, if necessary. 5a. Spray equipment from side angle, not straight on, to avoid backsplash. 5a. See 3b. 5b. See 4a. Review SDS to ensure appropriate precautions are taken and understood.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-009	DATE: 7/10/2020	☐ NEW ☒ REVISED	PAGE 1 of 1
JSA TYPE CATEGORY **Generic**	WORK TYPE **O&M**	WORK ACTIVITY (Description) **Movement of 55-Gallon Drums/Drum Handling with Mobile Carrier**		

DEVELOPMENT TEAM	POSITION / TITLE	REVIEWED BY:	POSITION / TITLE
Michael Sarni	Technician	Brian Hobbs	Corporate Health & Safety Manager

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST	☐ GOGGLES	☐ AIR PURIFYING RESPIRATOR	☒ GLOVES: Cut-resistant gloves
☒ HARD HAT	☐ FACE SHIELD	☐ SUPPLIED RESPIRATOR	☐ OTHER:
☐ LIFELINE / BODY HARNESS	☐ HEARING PROTECTION	☒ PPE CLOTHING: Fluorescent long sleeve shirt or long sleeve shirt and reflective safety vest.	
☒ SAFETY GLASSES	☒ SAFETY SHOES: Steel or composite toe		

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Mobile Drum Carrier, safety cones, and caution tape

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs

EXCLUSION ZONE (EZ): Maintain Minimum Heavy Equipment Exclusion Zone around equipment (i.e. forklift) and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, tip zone of the equipment, fall zone of the equipment and contents, distance that debris may travel during demolition activities and/or foot print of a structure to be demolished.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Preparing for and Inspection of Drum	**1a. FALL:** Tripping/falling due to uneven surface. Loose debris/garbage in work area.	1a. Clear area of loose garbage and debris. Inspect 55-gal drums for proper condition, labeling, check drum ring and bolts for tightness, inspect mobile drum carrier. 1a. Do a Test Lift to get a general sense of the weight of the drum. 1a. Inspect and use established pathways to avoid uneven terrain, weather-related hazards (i.e., debris, puddles, ice, etc.), and other obstructions. 1a. Secure work area and coordinate and communicate the planned work activities with other personnel working in the area. 1a. Delineate work area with 42” safety cones.
	1b. CONTACT/EXPOSURE: Drums could potentially be damaged or contain hazardous material. Mobile drum carrier could potentially be in poor working condition causing malfunctioning during operation.	1b. Prior to inspecting drums don cut-resistant gloves. If drum is not properly labeled, do not open and cease all drum transport activities. Immediately contact project manager and inform him/her of drum situation. 1b. Do not continue drum transport activities until further actions are determined by the project manager. 1b. If the drum is properly labeled, but leaking, improperly sealed or in poor condition, place drum in an over-pack drum. 1b. Inspect mobile drum carrier to ensure its overall integrity. Look for rust marks or potential weak points where the drum carrier could malfunction. Inspect the wheels to ensure that they easily turn and nothing is impeding their movement.
	1c. EXERTION/CAUGHT: Potential pinching/exertion hazards while securing ring/ tightening bolts	1c. Keep back straight and knees slightly bent while securing drum ring/tightening bolt. Wear cut-resistant gloves.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

2. Position drum clamp tightly in between drum ribs, securing drum clamp to drum with chain	**2a. CAUGHT:** Pinching fingers between drum clamp and handle/chain.	2a. Attach drum clamp with chain and tighten until snug. Do not place hands between drum clamp and drum as the chain is tightened; wear cut resistant gloves. Keep face away from drum when handling in case of escaping vapors.
Assess **[1]JOB STEPS**	**Analyze** **[2]POTENTIAL HAZARDS**	**Act** **[3]CRITICAL ACTIONS**
3. Disengage safety latches on handle, pull handle down until drum is lifted off ground and safety latches are reengaged; slightly suspending drum off the ground	**3a. EXERTION/ CONTACT:** Potential muscle strain associated with lifting/engaging drum/handle. Drum could shift/slip downward and crush toes.	3a. Ascertain whether the drum is overweight; if it is, then two people are needed to lower handle while drum is secured with clamp so that safety latches can be engaged. Keep body out of the line of fire of the handle (do not position head above handle) as it is being pushed down. Do not allow feet/toes to be positioned under the drum as it is being lifted; wear steel/composite toe boots.
	3b. CAUGHT: Fingers could be pinched while engaging/disengaging safety latches on handle	3b. Wear cut-resistant gloves while disengaging/reengaging safety latches. 3b. Avoid placing hands in pinch points.
4. Transport drums to designated location and disengage drum clamp (repeat Step 3 in reverse order)	**4a. FALL:** Tripping/ falling due to obstructions and uneven terrain. Potential for drum to fall during transport.	4a. Ensure transport path is free of potential obstructions that may cause the drum/carrier to become unstable. Position drum clamp between the ribs on the drum to prevent possible slipping.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy source – electricity, pressure, compression/tension.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

JOB SAFETY ANALYSIS Ctrl. No. GEN-013	DATE 7/10/2020	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE:	WORK ACTIVITY (Description):	
Generic	**Gauging and Sampling**	**Gauging and Sampling**	
DEVELOPMENT TEAM	**POSITION / TITLE**	**REVIEWED BY:**	**POSITION / TITLE**
Brandon Tufano	Staff Geologist	Brian Hobbs	Corporate Health & Safety Manager

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☒ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☐ GOGGLES ☐ FACE SHIELD ☐ HEARING PROTECTION ☒ SAFETY SHOES: Composite-toe or steel toe boots	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: Fluorescent reflective vest or high visibility clothing	☒ GLOVES: Leather, Nitrile and cut resistant ☒ OTHER: Knee pads, Insect Repellant, sunscreen (as needed)

REQUIRED AND / OR RECOMMENDED EQUIPMENT

42-inch Safety Cones, Caution Tape, Interface Probe and/or Water Level Meter, 20-lb., Type ABC Fire Extinguisher, Buckets. Tools as needed: Socket Wrench, Screw Driver, Crow Bar, Mallet, and Wire Brush.

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Mobilization to monitoring well(s).	**1a. FALL:** Personal injury from slip/trip/fall due to uneven terrain and/or obstructions.	1a. Inspect pathway and plan for most suitable designated pathway prior to mobilization. 1a. Use established pathways, walk and/or drive on stable, secure ground and avoid steep hills or uneven terrain. 1a. If working near open water with an unguarded edge, wear life vest.
	1b. CONTACT: With traffic/third parties.	1b. Identify potential traffic sources and delineate work area with 42-inch traffic safety cones. Position vehicle to protect against oncoming traffic. Use caution tape to provide a more visible delineation of the work area if necessary. 1b. Wear appropriate PPE including high visibility clothing or reflective vest. 1b. Face traffic, maintain eye contact with oncoming vehicles, and establish a safe exit route.
	1c. EXERTION: Muscle strain from lifting equipment	1c. Use proper lifting techniques when handling/moving equipment; bend knees and keep back straight. 4c. Use mechanical assistance or team lifting techniques when equipment is 50 lbs. or heavier. 4c. Make multiple trips to carry equipment.
	1d. EXPOSURE: To biological hazards.	1d. Inspect work area for bees and insects. 1d. Use insect/tick repellent as necessary.
2. Open/close well.	**2a. EXERTION:** Muscle strain.	2a. Use proper lifting techniques; keep back straight, lift with legs and bend knees when reaching to open/close well.
	2b. CAUGHT: Pinch/crush points associated with removing/replacing manholes and working with hand tools.	2b. Wear leather gloves or cut resistant gloves when working with well cover and hand tools. 2b. Use proper tools (ratchet and pry bar for well cover) and inspect before use. 2b. Do not put fingers under well cover.
	2c. CAUGHT: Pinch points associated with placing J-plug back onto PVC pipe.	2c. See 2b. 2c. Keep fingers out of line-of-fire when securing cap.
	2d. EXPOSURE: To potential hazardous vapors.	2d. No open flames/heat sources. 2d. To minimize exposure to vapors, allow well to vent after opening it and before sampling activities begin. 2d. Stand up-wind, if possible, to avoid inhaling vapors.
3. Gauge well.	**3a. CONTACT:** With contamination (e.g. contaminated groundwater).	3a. Wear chemical-resistant disposable gloves (over cut-resistant gloves) and safety glasses when gauging well. 3a. Insert and remove probe slowly to avoid splashing. 3a. Use an absorbent pad to clean probe.
	3b. CONTACT: With traffic.	3b. See 1b.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
4. Purge and sample well	**4a. EXPOSURE/CONTACT:** To contamination (e.g., SPH, contaminated groundwater, vapors) and/or sample preservatives.	4a. Open and fill sample jars slowly to avoid splashing and contact with preservatives. 4a. Wear cut-resistant gloves and chemical-resistant disposable gloves when sampling. 4a. Fill sample containers over purge container to avoid spilling water onto the ground. 4a. Use an absorbent pad to clean spills. 4a. When using a bailer to purge a well, pull the bailer slowly from the well to avoid splash hazards. 4a. When sampling or purging the water using a bailer, pour out water slowly to reduce the potential for splash hazards with groundwater. 4a. When using a tubing valve always remove the valve slowly after sample collection to release any pressure and avoid pressurized splash hazards. 4a. When collecting a groundwater sample always point sampling apparatus (tubing, bailer, etc.) away from face and body.
	4b. CONTACT: Personal injury from cuts, abrasions, or punctures by glassware or sharp objects.	4b. To avoid spills or breakage, place sample ware on even surface. 4b. Do not over tighten caps on glass sample ware. 4b. Wear chemical-resistant nitrile disposable gloves over cut-resistant (i.e., Kevlar) gloves when sampling and handling glassware (i.e., VOA vials) or when using cutting tools.
	4c. EXERTION: Muscle strain while carrying equipment.	4c. Use proper lifting techniques when handling/moving equipment, bend knees and keep back straight. 4c. Use mechanical assistance or team lifting techniques when equipment is 50 lbs. or heavier. 4c. Make multiple trips to carry equipment.
	4d. CONTACT: With traffic.	4d. See 1b.
	4e. CONTACT: Pinch points with groundwater pump components (i.e., wheel, line, clamps).	4e. Wear leather gloves when working with groundwater pumps. 4e. Never place hands on or near pinch points such as the wheel, clamps or other moving parts during pump operations. 4e. Use the correct mechanisms, such as a pump reel, to lower pump into well. 4e. Never attempt to manually stop any moving part of equipment including hose reels and/or tubing.
	4f. EXERTION: Muscle strain from repetitive motion of bailing and sampling a well.	4f. See 4c. 4f. Include a stretch break when repetitive motions are part of the task.
5. Management of purge water.	**5a. EXPOSURE/CONTACT:** To contamination (e.g., SPH, contaminated groundwater, vapors).	5a. Do not overfill container and pour liquids slowly so that they do not splash. 5a. Properly dispose of used materials/PPE in appropriate container in designated storage area.
	5b. EXERTION: Muscle strain from lifting/carrying and moving containers.	5b. Use proper lifting techniques when lifting / carrying or moving container(s) (see 4c.). 5b. Do not overfill container(s).
6. Decontaminate equipment.	**6a. EXPOSURE/CONTACT:** To contamination (e.g., SPH, contaminated groundwater, vapors).	6a. Work on the upwind side, where possible, of decon area. 6a. Wear chemical-resistant disposable gloves and safety glasses. 6a. Use an absorbent pad to clean spills.
	6b. CAUGHT: Pinch points associated with handling hand tools	6b. See 2b. 6b. Inspect hand tools for sharp edges before decontaminating.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-014	DATE: 7/10/2020	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY:	WORK TYPE:	WORK ACTIVITY (Description):	
Generic	**Drilling**	**Hollow Stem Auger Soil Borings / Well Installation**	
DEVELOPMENT TEAM	**POSITION / TITLE**	**REVIEWED BY:**	**POSITION / TITLE**
Douglas Ferraiolo	Staff Geologist	Brian Hobbs	Corporate Health & Safety Manager

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☒ GOGGLES: Spoggles required if winds exceed 15 mph. ☐ FACE SHIELD ☒ HEARING PROTECTION: (as needed). ☒ SAFETY SHOES: Steel or Composite Toe.	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: Fluorescent long-sleeve shirt or long-sleeve shirt and reflective safety vest.	☒ GLOVES: Leather, Cut-Resistant, and Nitrile. ☒ OTHER: Insect Repellant, Sunscreen (as needed).

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Truck-Mounted Drilling Rig or Track Rig, Saw, Hand Tools, Photoionization Detector, Multi-Gas Meter (or equivalent), Interface Probe, 20 lb. Type ABC Fire Extinguisher, 42" Cones & Flags, "Work Area" Signs.

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs

EXCLUSION ZONE (EZ): Maintain Minimum Heavy Equipment Exclusion Zone around equipment and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, tip zone of the equipment, fall zone of the equipment and contents, distance that debris may travel during demolition activities and/or foot print of a structure to be demolished.

"SHOW ME YOUR HANDS"
Driller and helper should show that hands are clear from controls and moving parts

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Mobilization / demobilization and establish a work area.	**1a. See Mobilization/ Demobilization JSA GEN-015.**	1a. See Mobilization / Demobilization JSA GEN-015.
2. Raising tower / derrick of drilling rig.	**2a. CONTACT:** Overhead hazards. **2b. CONTACT:** Amputation / crush points when raising the rig and instability of rig.	2a. Prior to raising the tower / derrick, the area above the drilling rig will be inspected for overhead hazards (wires, tree limbs, piping or other structures) that may be contacted by the rig's tower or drilling rods. 2a. The tower / derrick must not be raised beneath overhead power lines unless approved by the Roux PM. 2a. Maintain a minimum of 10' from all overhead structures. 2a. Do not move the rig while the tower / derrick is raised. 2b. Inspect the equipment prior to use and avoid any potential amputation points. 2b. Lower outriggers to ensure stability prior to raising rig tower derrick. Keep feet and body out of the line of fire when lowering out-riggers. 2b. Inspect the set-up location for uneven terrain. Level or avoid area if needed. 2b. If the rig needs to be mounted, be sure to use three points of contact.
3. Advancement of augers for soil boring installation.	**3a. CONTACT:** Equipment imbalance during advancement of drill equipment. **3b. CONTACT:** Flying / spraying debris. **3c. CAUGHT:** Limb/extremity amputation, abrasion, and crushing.	3a. Drillers will advance the borehole with caution to avoid causing the rig to become imbalanced and / or tip. 3a. The blocking and leveling devices used to secure the rig will be inspected by drillers and Roux personnel regularly to see if shifting has occurred. **3a. Drillers will maintain the "Purple Zone" policy surrounding augers to ensure no personnel come into contact with augers while in use. Workers will spray paint a 3' semi-circle surrounding the augers to visually show that no personnel should enter the "Purple Zone" while drilling activities are being conducted.** 3a. In addition, personnel and equipment that are non-essential to the advancement of the borehole will be positioned away from the rig at a distance that is at least as far as the boom is high (minimum exclusion zone of 20 feet). 3b. Wear all required PPE (especially hand, eye, and ear protection). 3b. Maintain minimum EZ distance (i.e. swing/tip radius of rig) when rig is in operation to avoid potential line of fire hazards from flying materials or debris. 3c. Inspect the equipment prior to use for potential pinch points. 3c. Test all emergency shutdown devices prior to drilling. 3c. Inspect drill head for worn surface or missing teeth; replace if damaged or blunt. 3c. Inspect augers, do not use if auger flight is damaged or bent.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
3. Advancement of augers for soil boring installation (Continued).		3c. Ensure all jewelry is removed, loose clothing is secured, and PPE is secured close to the body. 3c. All non-essential personnel should stay away from the immediate work area; position body out of the line-of-fire of equipment particularly when installing auger flights and steel override casings. 3c. Drillers and helpers will understand and use the "Show Me Your Hands" Policy. 3c. Spinning augers should have an exclusion zone of 20 feet when in operation.
	3d. FALL: Slip/trip/fall hazards.	3d. Inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions prior to mobilizing equipment. 3d. Do not climb over stored materials/equipment; walk around. Practice good housekeeping. 3d. Use established pathways and walk on stable, secure ground. 3d. Use three points of contact when mounting or dismounting the rig. 3d. Remove soil cuttings to avoid a tripping hazard from developing near augers.
	3e. EXPOSURE: Inhalation of contamination / vapors.	3e. Air monitoring using a calibrated photoionization detector (PID) to periodically monitor the breathing zone of the work area. 3e. The Action Level for breathing zone air is five parts per million (sustained) as detected by the PID. 3e. If a reading of >5ppm is recorded, the Roux field personnel must temporarily cease work, instruct all Site personnel to step away from the area of elevated readings and inform the Roux PM of the condition. The Roux PM will then recommend additional appropriate precautions in accordance with the site specific health and safety plan.
	3f. EXPOSURE: Noise and dust.	3f. Wet borehole area with sprayer to minimize dust. Stand upwind and keep body positioned away from rig. 3f. Wear hearing protection while drill rig is operating and / or the noise levels exceed 85 dBA.
	3g. EXERTION: Installing well casings and lifting augers.	3g. Keep back straight and bend at the knees. 3g. Utilize team lifting for objects over 50lbs. 3g. Use mechanical lifting device for odd shaped objects.
4. Installation of well materials.	**4a. CONTACT:** Installing well materials while also pulling up augers. **4b. CAUGHT:** Possible pinch or crush hazard assembling PVC and sending down the borehole. **4c. FALL:** Slip/trip/fall hazards with hand tools and materials. **4d. EXPOSURE:** Potential contamination, harmful vapors, dust, and / or noise. **4e. EXERTION:** Lifting heavy bags of materials to backfill borehole.	4a. Potential contact with augers during installation of well materials. 4a. Keep distance from augers and do not place any materials while augers are in motion. 4b. Keep all body parts out of potential pinch points while placing PVC together and sending down borehole. 4c. See 3d. 4d. See 3e and 3f. 4d. Stand upwind to avoid exposure to dust generated from packing materials. 4e. Ergonomic hazard lifting bags of sand and bentonite while packing the well.
5. Cleaning the auger flights	**5a. CONTACT:** Cuts/scrapes or puncture wound from contacting auger.	5a. Follow "Show Me Your Hands" Procedure and make sure auger is out of gear before contacting auger with tool or hand. 5a. Pull cleaning tool across your body with handle away from body; do not push toward the auger. 5a. Do not clean more than ¾ turn around the auger at a time. 5a. Wear cut resistant and leather gloves. 5a. Always use two hands to operate cleaning tool. 5a. Inspect tool before use and remove from service if handle or metal are cracked/fatigued. 5a. Stand out of the line of fire.
6. Decontaminate equipment.	**6a. EXPOSURE / CONTACT:** To contamination (e.g., contaminated groundwater, vapors). **6b. EXPOSURE**: To chemicals in cleaning solution (including ammonia).	6a. Wear chemical-resistant disposable gloves and safety glasses. 6a. Contain decontamination water so that it does not spill. 6a. Use an absorbent pad to clean spills, if necessary. 6b. See 3e. Wear all appropriate PPE and stand upwind of any exposed cleaning solutions.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

JOB SAFETY ANALYSIS	Ctrl. No. GEN-015	DATE: 7/10/2020	☐NEW ☒REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)	
GENERIC	**Site Recon**	**Mobilization/Demobilization**	
DEVELOPMENT TEAM	**POSITION / TITLE**	**REVIEWED BY:**	**POSITION / TITLE**
Rebecca Lowy	Staff Assistant Geologist	Brian Hobbs	Corporate Health & Safety Manager
Tally Sodre	OHSM		

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☐ GOGGLES ☐ FACE SHIELD ☒ HEARING PROTECTION (as needed) ☒ SAFETY SHOES: Steel Toe or composite toe	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: Fluorescent reflective vest of high-visibility clothing; long sleeve shirt; long pants	☒ GLOVES: Leather, nitrile, and cut resistant (as needed) ☐ OTHER

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Required Equipment: Varies

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs

EXCLUSION ZONE (EZ): Maintain Minimum Heavy Equipment Exclusion Zone around equipment and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, tip zone of the equipment, fall zone of the equipment and contents, distance that debris may travel during demolition activities and/or foot print of a structure to be demolished.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Mobilize/demobilize and establish work area	**1a. FALL:** Slip/trips/falls from obstructions, uneven terrain, weather conditions, heavy loads, and/or poor housekeeping.	1a. Use 3 points-of-contact/ensure secure footing when entering and exiting vehicle. 1a. Inspect walking path for uneven terrain, steep hills, obstructions, and/or weather-related hazards (i.e., ice, snow, and puddles) prior to mobilizing equipment. Use established pathways. Walk on stable/secure ground. 1a. Do not climb over stored materials/equipment; walk around. Practice good housekeeping; organize and store equipment neatly in one area at its lowest potential energy. 1a. Wear boots with adequate treads. 1a. Delineate unsafe areas with 42” cones, caution tape and/or flagging.
	1b. CONTACT: Personal injury and/or property damage caused by being struck by Site traffic or equipment used in Site activities.	1b. Observe and maintain the posted speed limits. 1b. When first arriving onsite, park vehicles in designated parking space and/or out of the way locations. Use parking brake on all vehicles and tire chocks on work trucks and trailers. 1b. Check in with Site Manager/Supervisor to ensure coordination with other Site activities and to discuss any special hazards. Ensure that short-service employees (SSE) are identified. 1b. Identify potential traffic sources. 1b. Wear PPE including high visibility clothing or reflective vest. 1b. Use a spotter while moving work vehicles; plan ahead to avoid backing whenever possible. 1b. Maintain a minimum exclusion zone when vehicles are in motion (i.e. greater than swing/tip radius of equipment). When backing up truck rig with an attached trailer use a second spotter if there is tight clearance simultaneously on multiple sides of the equipment or if turning angles limit driver-to-spotter visibility. 1b. Delineate work area with 42” cones, flags, caution tape, and/or other barriers. 1b. Position “Work Area” signs at Site entrances, if possible, or at either side of work area.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
		1b. Position largest vehicle to protect against oncoming traffic. 1b. Face traffic, maintain eye contact with oncoming vehicles, use a spotter, and establish a safe exit route. 1b. Observe potential overhead and ground surface features that may interfere with moving equipment. Clear the path of physical hazards prior to initiating mobilization.
	1c. CAUGHT: Personal injury from pinch points and being in line-of-fire of vehicle and/or equipment.	1c. Make sure driver has engaged parking brake and placed wheel chocks in a position to prevent movement. Be sure that vehicle is parked in front/down gradient (positioned to best block oncoming traffic) of work area. 1c. Wear leather gloves when handling any tools or equipment. Wear cut-resistant gloves (Kevlar or similar) when handling sharp objects/cutting tools/glass. 1c. Keep body parts away from line-of-fire of equipment. 1c. Always carry tools by the handles and/or designated carrier. Ensure sharp-edged tools are sheathed/secure. 1c. Remove any loose jewelry. Avoid wearing loose clothing and/or ensure loose clothing is secure. 1c. Secure all items on the equipment, tighten up any items or features that have potential to shift or break during mobilization.
	1d. OVEREXERTION: Muscle strains while lifting/carrying equipment.	1d. Use body positioning and lifting techniques that avoid muscle strain; keep back straight, lift with legs, turn with whole body, keep load close to body, and never reach with a load. 1d. Ensure that loads are balanced. Use assistance (mechanical or additional person) to carry equipment that is either unwieldy or over 50 lbs.
	1e. EXPOSURE: Personal injury from exposure to biological and environmental hazards.	1e. Inspect area to avoid contact with biological hazards (i.e. poisonous plants, stinging insects, ticks, etc.). 1e. Wear long sleeved clothes treated with Permethrin, apply insect repellant containing DEET to exposed skin, and inspect clothes and skin for ticks during and after work. 1e. Apply sunscreen (SPF 15+) if exposure to sun for 30 minutes or more is expected.
	1f. EXPOSURE: Weather related injuries.	1f. Watch for heat stress symptoms (muscle cramping, exhaustion, dizziness, nausea, rapid and shallow breathing). Take breaks in cool places and hydrate as needed. 1f. Watch for cold stress symptoms (severe shivering, slowing of body movement, weakness, stumbling or inability to walk, collapse). Take breaks in warm areas as needed. 1f. Wear clothing appropriate for weather and temperature conditions (e.g., rain jackets, snow pants, multiple layers). 1f. If lightning is observed, wait 30 minutes in a sheltered location (car is acceptable) before resuming work.
	1g. EXPOSURE: Personal injury from noise hazards.	1g. Wear hearing protection if sound levels exceed 85 dBA (if you must raise your voice for normal conversation).

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-017	DATE: 7/10/2020	☐NEW ☒REVISED	PAGE 1 of 2

JSA TYPE CATEGORY:	WORK TYPE:	WORK ACTIVITY (Description):	
GENERIC	**Drilling**	**Monitoring and Recovery Well Development**	
DEVELOPMENT TEAM	**POSITION / TITLE**	**REVIEWED BY:**	**POSITION / TITLE**
Ron Lombino	Project Geologist	Brian Hobbs	Corporate Health & Safety Manager
Courtney Lind	Project Engineer		

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☐ GOGGLES ☐ FACE SHIELD ☒ HEARING PROTECTION (as needed) ☒ SAFETY SHOES: Composite-toe or steel toe boots	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: Fluorescent reflective vest or high visibility clothing	☒ GLOVES: Leather or cut-resistant and Nitrile ☒ OTHER: Insect repellant, sunscreen (as needed)

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Required Equipment as needed: Truck Rig or support truck, Trailer, 42-inch Safety cones and flags, Caution Tape, Interface Probe, Power Source, Submersible Pump, Surge Block/Plunger, 20 lb. Type ABC Fire Extinguisher, Holding Tanks and/or Buckets, Absorbent Pads, 5-gas meter, Tools as needed: Socket and Pipe Wrench, Screw Driver, Pry Bar, Ratchet, Vault Key.

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs

EXCLUSION ZONE (EZ): Maintain Minimum Heavy Equipment Exclusion Zone around equipment and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, tip zone of the equipment, fall zone of the equipment and contents, distance that debris may travel during demolition activities and/or foot print of a structure to be demolished.

"SHOW ME YOUR HANDS"
Driller and helper should show that hands are clear from controls and moving parts

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Mobilization / Demobilization (**Review Mobilization and Demobilization JSA**)	**1a. CONTACT:** Equipment/property damage.	1a. The truck rig's tower/derrick will be lowered and secured prior to mobilization. 1a. Set-up the work area / position equipment in a manner that eliminates or reduces the need for backing of trucks and trailers. 1a. All non-essential personnel should **maintain an exclusion zone greater than the swing/tip radius of equipment.** 1a. Beep horn twice before backing up. 1a. When backing up with an attached trailer use a spotter Level or avoid if needed.
	1b. FALL: Slip/trip/fall hazards.	1b Inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions prior to mobilizing equipment. 1b. Do not climb over stored materials/equipment; walk around. Store equipment at lowest potential energy.
2. Open/close well.	**2a. EXERTION:** Muscle strain (some wells have large vault covers).	2a. Keep back straight, lift with legs, keep load close to body, and never reach with a load. Ensure that loads are balanced to reduce the potential for muscle strain. Two people are required when lifting objects over 50 lbs or when the shape makes the object difficult to lift.
	2b. CAUGHT: Pinch points associated with removing/replacing manholes and working with hand tools.	2b. Wear cut-resistant/leather gloves when working with well vault/cover and hand tools. Do not put fingers under well vault/cover. 2b. Use ratchet and pry bar for well cover and inspect before use.
	2c. EXPOSURE: Potentially hazardous vapors.	2c. No open flames/heat sources. 2c. Allow well to vent after opening it and before starting development activities to minimize exposure to vapors. Air monitoring must be performed prior to set up and during the well development activities. Work on upwind side of well.
	2d. CONTACT: Traffic.	2d. Wear required PPE including high visibility clothing or reflective vest. 2d. Delineate work area with 42" safety cones and/or other barriers. Position vehicle to protect against oncoming traffic. 2d. Face traffic, maintain eye contact with oncoming vehicles, and establish a safe exit route.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – Electricity, Pressure, compression, tension, torque.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
3. Develop well (mechanical surging).	**3a. CAUGHT:** Cut hazards and finger pinch points.	3a See 2b. 3a. Use required PPE including leather/cut-resistant gloves when handling development equipment. Identify finger/hand pinch points. Keep hands away from active surge equipment. 3a. All non-essential personnel should **maintain an exclusion zone greater than the swing/tip radius of equipment.**
	3b. CONTACT/EXPOSURE: Contamination (e.g., SPH, contaminated groundwater, vapors).	3b. See 2c. 3b. Wear Nitrile gloves and safety glasses. Insert and remove surge block/plunger and line/cable slowly to avoid splashing at the surface. 3b. Use an absorbent pad to clean any spills.
	3c. EXERTION: Muscle strain from lifting equipment.	3c. See 2a. 3c. Use mechanical device to insert and remove surge block/plunger if greater than 50lb.
	3d. CONTACT: Injury while handling wench line/cable, or with active surging equipment.	3d. If using a drill rig, inspect all wench lines/cables for any kinks or if frayed prior to use. Replace any damaged lines/cables. Review **Drill Rig checklist prior to development activities**. 3d. See 3a.
4. Purging well (pumping water to holding tanks/drums/buckets).	**4a. CAUGHT:** Pinch points associated with connecting hose to tank. Pinch points associated with handling pump and hoses.	4a. See 3a. 4a. Ensure that fingers are not placed near coupling when attaching and securing hose(s). Do not place fingers under pump/hoses. Wear leather or cut-resistant gloves when handling pump/hose(s). 4a. Keep hands clear from any line of fire.
	4b. FALL: Using side mounted ladder when attaching hose to tank. Slip, trip, fall from lines/hoses	4b. Inspect ladder steps to make sure steps are not bent/damaged and free of debris/fluid. 4b. Use three points of contact always when using ladder. 4b. Use hoist or other mechanical means to secure and move hose. 4b. Utilize anti-whip cords on all compressed hoses. Keep hoses and lines coiled and organized out of designated walking paths around the work zone.
	4c. CONTACT: Contamination (e.g., SPH, contaminated groundwater).	4c. Secure water hose. 4c. Do not overfill tanks, and purge/transfer liquids in such a manner that they do not splash. (See 3b). 4c. Dispose of used materials/PPE in the designated impacted PPE container.
	4d. EXERTION: Muscle strain from lifting/carrying equipment.	4d. See 2a.
	4e. FALL: Spilled purge water.	4e. Clean up any spills using absorbent pads or spill kits.
5. Decontaminate equipment	**5a. CONTACT/EXPOSURE:** Contamination (e.g., SPH, contaminated groundwater, vapors).	5a. See 3b.
	5b. EXPOSURE/CONTACT: Chemicals in cleaning solution	5b. Decontaminate equipment in well-ventilated area. Wear nitrile gloves to avoid skin contact with cleaning solutions.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – Electricity, Pressure, compression, tension, torque.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETYANALYSIS Ctrl. No. GEN-020	DATE: 7/10/2020	☐NEW ☒REVISED	PAGE 1 of 2

JSA TYPE CATEGORY:	WORK TYPE:	WORK ACTIVITY (Description):	
GENERIC	**Gauging & Sampling**	**Soil Sampling**	
DEVELOPMENT TEAM	**POSITION / TITLE**	**REVIEWED BY:**	**POSITION / TITLE**
MaryBeth Lyons	Project Scientist	Brian Hobbs	Corporate Health and Safety Manager

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST	☐ GOGGLES	☐ AIR PURIFYING RESPIRATOR	☒ GLOVES: Leather, Nitrile and cut resistant
☒ HARD HAT	☐ FACE SHIELD:	☐ SUPPLIED RESPIRATOR	
☐ LIFELINE / BODY HARNESS	☒ HEARING PROTECTION: (as needed)	☒ PPE CLOTHING: Fluorescent reflective vest or high visibility clothing	☒ OTHER: Insect repellant, sunscreen (as needed)
☒ SAFETY GLASSES	☒ SAFETY SHOES: Composite-toe or steel toe boots		
☒ FLAME RESISTANT CLOTHING (as needed)			

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Recommended Equipment: 42" traffic cones, caution tape, trowel

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs.

EXCLUSION ZONE (EZ): Maintain Minimum Heavy Equipment Exclusion Zone around equipment and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, tip zone of the equipment, fall zone of the equipment and contents, distance that debris may travel during demolition activities and/or foot print of a structure to be demolished.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Secure location	**1a. CONTACT:** Personnel and vehicular traffic may enter the work area.	1a. If in an area with foot or vehicle traffic, delineate the work area with 42" traffic cones and/or caution tape to prevent exposure to traffic and inform others of work activity. 1a. Wear reflective vest and/or high visibility clothing. 1a. Face the direction of any vehicular traffic. Position vehicle to protect worker from traffic. 1a. Communicate work activity with adjacent work areas.
	1b. FALL: Tripping/falling due to uneven terrain or entry/exit from excavations.	1b. Inspect pathways and work area for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions. 1b. Use established pathways and walk on stable, secure ground. 1b. Stage equipment and tools in a convenient, stable, and orderly manner. Store equipment at lowest potential energy. 1b. Roux employees should stay 5 feet from in-progress excavations and trenches. Should entry to an excavation be required (when stabilization is complete), ladders must be employed for steep embankments, excavations, pits, and trenches.
	1c. EXPOSURE: Exposure to sun and excessive heat, possibly causing sunburn, heat exhaustion or heat stroke. Exposure to cold temperatures possibly causing cold stress. Skin burn as a result of fire, if applicable. Exposure to explosive vapors due to tank farm operations. Exposure to airborne dust due to high wind speeds. Biological hazards - ticks, bees/wasps, poison ivy, thorns, insects, etc.	1c. Wear sunscreen with an SPF 15 or greater whenever 30 minutes or more of exposure is expected. 1c. Use a tent to shade the work area from direct sunlight particularly when warm temperatures are expected. 1c. Be aware of the location of all Site personnel. 1c. Watch for heat stress symptoms (muscle cramping, exhaustion, dizziness, rapid and shallow breathing). 1c. Watch for cold stress symptoms (severe shivering, slowing of body movement, weakness, stumbling or inability to walk, collapse). 1c. Take breaks for rest and water as necessary. Move to an area that is well shaded or a climate controlled area (i.e., car, site trailer, etc.). 1c. No open flames/heat sources. 1c. Flame retardant clothing must be worn when specified by Site policy. 1c. Cell phones should be disabled when specified by Site policy. 1c. Pre-treat field clothing with Permethrin prior to site visit to kill ticks and insects. 1c. Wear long sleeved shirts and tuck in (or tape) pant legs into socks or boots to prevent ticks from reaching skin. 1c. Spray insect repellant containing DEET on exposed skin when working in overgrown areas of the Site. 1c. Inspect area to avoid contact with biological hazards. 1c. Wear cut-resistant gloves when handling branches, shrubs, etc. that may lie within the walking path. 1c. Wear spoggles if the average wind speeds are above 15 mph. 1c. Personnel shall examine themselves and co-worker's outer clothing for ticks periodically when onsite. 1c. If skin comes in contact with poison ivy, wash skin thoroughly with soap and water. If rash persists after washing, immediately notify your supervisor, the OM and OHSM for possible consultation with a physician at an approved Occupational Health Clinic.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
2. Collect Soil Sample	**2a. CONTACT:** Personal injury from pinch points, cuts, and abrasions from sampling equipment tools, and material within soil sample. Personal injury from contact with moving equipment while sampling. Personal injury from contact with glass sample jars.	2a. Wear cut-resistant (i.e., Kevlar) gloves under chemical-resistant (nitrile) disposable gloves when handling soil samples and sampling jars. 2a. Where possible, use trowel or equivalent tool to avoid contact with soil. 2a. If sampling from bucket of heavy equipment, ensure all equipment is off and operator utilizes the “show me your hands” policy. 2a. See 1a.
	2b. EXPOSURE: Exposure to contamination (impacted soil) and/or lab preservatives.	2b. Wear chemical-resistant (nitrile) disposable gloves over cut resistant gloves to protect hands when handling samples; use containment material or plastic sheeting to protect surrounding areas. 2b. Wear safety glasses to protect eyes from dust or air-borne contaminants that may results from disturbing the soil. 2b. Where possible, remain upgradient from sample location if collecting soil sample from stockpile, drill rig, etc. to avoid breathing contaminant vapors, if they are present. 2b. When collecting soil sample from hand auger, put large zip lock bag over entire auger to prevent spillage of soil on to the ground. 2b. Open sample jars slowly and fill carefully to avoid contact with preservatives.
	2c. EXERTION: Exertion due to repetitive motion and ergonomics.	2c. Utilize a table or raised surface for soil sampling if multiple soil samples are going to be taken to minimize repetitive bending motion.
3. Decontaminate equipment	**3a. EXPOSURE/CONTACT:** Contamination (e.g., Separate Phase Hydrocarbons (SPH), contaminated vapors and/or soil).	3a. Wear chemical-resistant (nitrile) disposable gloves and safety glasses. 3a. Use an absorbent pad to clean spills. 3a. Properly dispose of used materials/PPE in provided drums in designated drum storage area. 3a. Remain upwind of sample and avoid breathing contaminant vapors, if they are present.
	3b. EXPOSURE: Chemicals in cleaning solution including ammonia.	3b. Wear chemical-resistant (nitrile) disposable gloves and safety glasses. 3b. Work on the upwind side of decontamination area. 3b. Use an absorbent pad to clean spills. 3b. Properly dispose of used materials/PPE in provided drums in designated drum storage area. Ensure that all drums are properly labeled and secured.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-021	DATE: 7/10/2020	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY:	WORK TYPE	WORK ACTIVITY (Description)
GENERIC	**Gauging and Sampling**	**Soil Vapor Sampling (Permanent Monitoring Points)**

DEVELOPMENT TEAM	POSITION / TITLE	REVIEWED BY:	POSITION / TITLE
Jeff Wills	Senior Hydrogeologist	Brian Hobbs	Corporate Health and Safety Manager

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST	☐ GOGGLES	☐ AIR PURIFYING RESPIRATOR	☒ GLOVES: Cut-resistant & Nitriles
☒ HARD HAT	☐ FACE SHIELD	☐ SUPPLIED RESPIRATOR	☒ OTHER: Bug Spray, Sun Screen, Knee Pads or kneeling pad
☐ LIFELINE / BODY HARNESS	☐ HEARING PROTECTION	☒ PPE CLOTHING: Fluorescent reflective vest or high visibility clothing	
☒ SAFETY GLASSES	☒ SAFETY SHOES: Steel-toe boots		

REQUIRED AND / OR RECOMMENDED EQUIPMENT

9/16" Socket and Wrench, Non-Toxic Clay, Teflon-Lined Tubing, Masterflex Tubing, Air Pump with Low Flow, Dry Cal, Enclosure (Bucket with 2 holes), Helium Gas Canister, Summa Canisters and Flow Controllers, MultiRae Photo Ionization Detector (PID), Helium Detector, Tubing Cutter, 42-inch Safety Cones, Caution Tape or Retractable Cone Bars

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs.

Work Zone (WZ): A 5-foot exclusion zone will be maintained for non-essential personnel.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Define and secure work area.	**1a. FALL:** Potential tripping hazards.	1a. Ensure work area is secure and inform others (third party) of work activity. 1a. Remove tripping hazards and inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions prior to mobilizing equipment.
	1b. CONTACT: Potential contact with moving vehicles or pedestrians.	1b. If working alongside roads, look both ways before entering roadways, face traffic, and utilize work vehicle to protect employees. 1b. Delineate work area (including vehicles) with traffic safety cones and caution tape or retractable cone bars. 1b. Maintain a 5-foot work zone. 1b. Wear high visibility clothing or reflective safety vest.
	1c. EXERTION: Muscle strain while lifting and carrying equipment.	1c. When carrying equipment to/from work area, keep back straight, lift with legs, keep load close to body, never reach with a load. Ensure that loads are balanced. Use mechanical assistance/make multiple trips to carry equipment.
2. Remove well cover / close well cover.	**2a. CONTACT/CAUGHT:** Pinch points and scrapes associated with hand tools and well covers.	2a. Keep hands away from pinch points. 2a. Use hand tools with extensions to remove and replace well covers. 2a. Wear cut-resistant gloves. 2a. Use knee pads or kneeling pad when repetitive kneeling on rough ground is anticipated.
	2b. FALL: Potential tripping hazards associated with installing bolts.	2b. Place security bolts in secure location so not to create tripping hazards. Replace security bolts so that they fit flush with monitoring well covers.
	2c. EXERTION: Physical exertion to remove bolts that were over torqued or stripped.	2c. Replace any security bolts that show signs of stripping. Do not over tighten. 2c. Use body positioning and bending techniques that minimize muscle strain; keep back straight, bend at the knees. 2c. See 2a.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – Electricity, pressure, tension/compression, torque.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
3. Screen vapor point with PID.	**3a. FALL:** Potential tripping hazards associated with equipment. **3b. EXPOSURE:** Inhalation of soil vapor	3a. Place equipment in one area close to the sampling location. 3b. Identify area where equipment is to be stored within the work area (away from main walking path). 3a. Don't leave equipment on the ground. Return equipment to storage area between uses. 3b. Replace brass caps immediately upon completion to avoid soil vapors migrating to the surface through sample tubing. 3b. Stand upwind of sample point during screening activities.
4. Remove / replace brass caps at the end of the sam`ple tubing.	**4a. CONTACT:** Pinch points associated with hand tools and brass caps. **4b. EXPOSURE:** Potential pathway for vapors to migrate to land surface.	4a. Use wrench to remove and replace brass caps. 4a. Wear cut-resistant gloves to protect against pinch points and scrapes. 4b. See 3b. 4b. Stand up wind of sample point location.
5. Set up soil vapor sampling equipment and calibration of meters.	**5a. FALL:** Potential tripping hazards associated with equipment and tubing.5b. **5b. CONTACT:** Pinch points associated with handling equipment. **5c. EXPOSURE:** Inhalation of calibration gas and helium.	5a. See 3a. 5a. Keep tubing slack to a minimum and locate the summa canister as close to the sampling location as possible. 5a. Avoid stepping over equipment and tubing. 5b. Do not place fingers/hands under sampling equipment. 5b. Make multiple trips when unloading equipment in work area. 5b. Wear cut-resistant gloves to protect against pinch points while handling sampling equipment. 5c. Review SDS for each type of calibration gas used before calibrating. 5c. Calibrate meters in a well-ventilated area and keep air flow regulator away from face. 5c. Close valve on canisters after use to avoid inhalation of excess helium or calibration gas. 5c. Stand up wind of bucket during helium tracer gas test.
6. Cleaning Work Area.	**6a. FALL:** Potential tripping hazards associated with equipment and tubing. **6b. CONTACT:** Storing and transport of equipment in car.	6a. See 3a. 6a. See 3b. 6b. Ensure that equipment is placed securely in the vehicle. Do not stack equipment on top of each other. Secure equipment so that it will not slide while being transported. 6b. Wear cut-resistant gloves while handling/loading equipment.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – Electricity, pressure, tension/compression, torque.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Cntrl. No. GEN-027	DATE: 11/3/2020	☒ NEW ☐ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
GENERIC	**Drilling**	**Pre-Drilling Clearance, Vactron and Air Knife**

DEVELOPMENT TEAM	POSITION / TITLE	REVIEWED BY:	POSITION / TITLE
Courtney Rempfer	Staff Scientist	Joseph Midwig	Office Health & Safety Manager
Sara Redding	Senior Hydrogeologist	Brian Hobbs	Corporate Health & Safety Manager

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☐ GOGGLES ☒ FACE SHIELD (While Air Knifing) ☒ HEARING PROTECTION (As needed) ☒ SAFETY SHOES: Composite toe or steel toe boots	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: Fluorescent reflective vest or high visibility clothing; long-sleeve shirt	☒ GLOVES: Leather, Nitrile, cut-resistant ☒ OTHER: Dusk mask, insect repellant, sunscreen (as needed)

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Vac-Truck or Vac Drum, Compressor, Jack Hammer, Air Knife. Circular Saw, Hand Tools, Dust Mask, Photoionization Detector, Multi Gas Meter, 42 inch safety cones and flags, Retractable Cone Bars, Caution Tape, 20 lb. Fire Extinguisher, "Work Area" Signs, Pressurized Water Sprayer

Commitment to Safety – All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing SPSAs

EXCLUSION ZONE: All non-essential personnel will maintain a distance of 10 feet from drilling equipment while equipment is moving/engaged

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Verify pre-clearance protocol	**1a. CONTACT:** Underground utility damage; property damage; personal injury	1a. Confirm that (if applicable) "Call Before You Dig" and local utility companies were contacted prior to starting work in order to confirm utility mark outs. Must have a case # before digging. 1a Walk the Site to evaluate utility markings and review maps (see Site Walk Inspection JSA). Utilities are not always properly marked out ensure use of observational skills through the pre-clearing checklist. 1a. Review pre-clearing checklist fromm and sub-surface clearance form. Pre-clearing protocol indicates that clearance must be conducted to a minimum of 5 vertical feet below ground surface or 10 vertical feet below ground surface in the critical zone using hand tools.
	1b. ENERGY SOURCE/CONTACT: Property damage; Pressurized water mains may cause lacerations or broken bones. Pressurized gas mains may explode causing serious injury, or death. Underground electric may cause severe burns, shock, or death.	1b. Pre-clearing of each soil boring/monitoring well location must be conducted to a minimum of 5 vertical feet below the ground surface (10 feet minimum for Critical Zone) using hand tools (shovel and non-metallic dig bar and hand auger) prior to drilling. Supervisor should be contacted to discuss appropriate pre-clearing depth. 1b. MUST Complete subsurface clearance checklist prior to pre-clearance.
	1c. FALL: Slip, Trip or Fall may cause muscle strains or tears, abrasions, lacerations, or broken bones.	1c. Be aware of the conditions when walking or loading equipment and working. Walk within established pathway avoiding uneven surfaces. Remove potential slip/trip/fall hazards.
2. Mobilize/demobilize and establish work area	**2a. SEE MOBILIZATION / DEMOBILIZATION JSA**	2a. See Mobilization / Demobilization JSA
3. Concrete saw cutting, jack hammer and hand clearance with hand tools, air knife	**3a. CONTACT:** Flying debris striking face or body	3a Maintain 10' minimum exclusion zone. Use the required PPE (i.e., leather/cut proof gloves, safety glasses/face shield). 3a. Use anti-whip devices on compressor hoses. 3a Wear a face shield to protect face from flying debris when using air knife. 3a. Utilize a traffic cone or physical barriers over the hole during air knife activities to keep flying debris close to ground.
	3b. EXPOSURE: Inhalation/exposure to hazardous vapors and/or concrete dust, noise exposure	3b. Monitor breathing zone with a calibrated PID and/or multi-gas meter. If meters sustain readings greater than recommeneded in the HASP for the specific contaminant of concerns (COCs) the Roux field personnel must temporarily cease work, instruct all Site personnel to step away from the area of elevated readings. Contact PM. 3b. Wet concrete while using saw to minimize dust and wear dust mask to prevent inhalation. 3b. Stand upwind and keep body behind saw. Observers and helpers should avoid line of fire for saw blade. Always cut away from body. 3b. No open flames/heat sources. 3b. Wear hearing protection when saw, jackhammer or air compressor are in operation. Otherwise, if sound levels exceed 85 dbA, put on hearing protection.
	3c. ENERGY SOURCE/CONTACT: Property damage; Pressurized water	

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into five types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

	mains may cause lacerations or broken bones. Pressurized gas mains may explode causing serious injury, or death. Underground electric may cause severe burns, shock, or death.	3c. For air knifing, ensure extention/lance tip reaches the full 5 feet bgs. Air knife should be advanced **AT A MINIMUM** in all four corners of the expected boring location to find any possible arrangement of utilities. 3c. Ensure diameter of soil preclearance hole is at a **MINIMUM 2x** the diameter of any drilling or hard dig equipment that will be entering the hole. 3c. See Complete subsurface clearance protocol for information provided above.
	3d. ERGONOMICS/EXERTION: Muscle strain due to poor body positioning when handling equipment and materials	3d. Use body positioning and lifting techniques that minimizes muscle strain; keep back straight, lift with legs, keep load close to body, and never reach with a load. 3d. Ensure that loads are balanced to reduce the potential for muscle strain. 3d. Two people or a mechanical lifting aid are required when lifting objects over 50 lbs. or when the shape makes the object difficult to lift.
	3e. FALL: Tripping/falling due to uneven terrain, weather conditions, and materials/equipment stored at the Site	3e. Inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions prior to mobilizing equipment. Mob/Demob JSA. 3e. Do not climb over stored materials/equipment; walk around. Practice good housekeeping. 3e. Use established pathways and walk on stable, secure ground. 3e. Equipment and tools will be stored at the lowest point of potential energy and out of the walkway and immediate work area (i.e. tools should not be propped against walls or nearby equipment or vehicles). 3e. Equipment and tools that are not anticipated to be used will be returned to a storage area that is out of the immediate work area. 3e. Ensure power cords and compressed air lines are grouped when used within the work area. 3e. Pre-cleared location will be finished flush to grade as to prevent a slip/trip hazard or coned and taped off.
	3f. CAUGHT: Amputation points associated with the equipment and vacuum hose	3f. Always wear leather gloves when making connections and using hand tools; wear cut-resistant (i.e., Kevlar) gloves when handling cutting tools. 3f. Inspect the equipment prior to use for potential pinch points. 3f. Test all emergency shutdown devices prior to using equipment. 3f. Inspect saw blade for worn surface or missing teeth; switch blade if damaged or blunt. 3f. Ensure all jewelry is removed, loose clothing is secured, and PPE is secured close to the body. 3f. All non-essential personnel shall maintain a 10 foot exclusion zone; position body out of the line-of-fire of equipment. 3f. Drillers and helpers will understand and use the “Show Me Your Hands Policy”.
4. Move drum to staging area using drum cart	**4a. EXPOSURE/CONTACT:** Contamination (e.g., Separate Phase Hydrocarbons (SPH), contaminated groundwater, soil)	4a. Wear Nitrile chemical-resistant gloves under leather or cut proof gloves. 4a. Do not overfill drums. Ensure that the drum lids are attached securely. 4a. All drums will be staged in the designated storage area.
	4b. EXERTION: Muscle strain while maneuvering drums with drum cart/lift gate	4b. See 3d. Do not overfill drums. Use lift gate on back of truck to load and unload drums. Use drum dolly to move drum.
	4c. CAUGHT: Pinch points associated with handling drum lid	4c. Ensure that fingers are not placed under the lid of the drum. Wear leather gloves or cut proof gloves. Use appropriate ratchet while sealing drum lid.
5. Decontaminate equipment.	**5a. EXPOSURE/CONTACT**: To contamination (e.g., Separate Phase Hydrocarbons (SPH), contaminated groundwater, vapors).	5a. Wear chemical-resistant disposable gloves and safety glasses. 5a. Contain decontamination water so that it does not spill. 5a. Use an absorbent pad to clean spills, if necessary. 5a. Spray equipment from side angle, not straight on, to avoid backsplash. 5a. See 3b.
	5b. EXPOSURE: To chemicals in cleaning solution.	5b. See 4a. Review SDS to ensure appropriate precautions are taken and understood.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into five types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

APPENDIX B

SDSs for Chemicals Used

Safety Data Sheet

according to 1907/2006/EC (REACH), 1272/2008/EC (CLP), 29CFR1910/1200 and GHS Rev. 3

Effective date: 12.08.2015 **Revision** : 12.10.2015

Trade Name: Alconox

1 Identification of the substance/mixture and of the supplier

1.1 Product identifier

Trade Name: Alconox
Synonyms:
Product number: Alconox

1.2 Application of the substance / the mixture : Cleaning material/Detergent

1.3 Details of the supplier of the Safety Data Sheet

Manufacturer
Alconox, Inc.
30 Glenn Street
White Plains, NY 10603
1-914-948-4040

Supplier
Not Applicable

Emergency telephone number:
ChemTel Inc
North America: 1-800-255-3924
International: 01-813-248-0585

2 Hazards identification

2.1 Classification of the substance or mixture:

In compliance with EC regulation No. 1272/2008, 29CFR1910/1200 and GHS Rev. 3 and amendments.

Hazard-determining components of labeling:
Tetrasodium Pyrophosphate
Sodium tripolyphosphate
Sodium Alkylbenzene Sulfonate

2.2 Label elements:

Skin irritation, category 2.
Eye irritation, category 2A.

Hazard pictograms:

Signal word: Warning

Hazard statements:
H315 Causes skin irritation.
H319 Causes serious eye irritation.

Precautionary statements:
P264 Wash skin thoroughly after handling.
P280 Wear protective gloves/protective clothing/eye protection/face protection.
P302+P352 If on skin: Wash with soap and water.
P305+P351+P338 If in eyes: Rinse cautiously with water for several minutes. Remove contact lenses if present and easy to do. Continue rinsing.
P321 Specific treatment (see supplemental first aid instructions on this label).
P332+P313 If skin irritation occurs: Get medical advice/attention.
P362 Take off contaminated clothing and wash before reuse.
P501 Dispose of contents and container as instructed in Section 13.

Safety Data Sheet

according to 1907/2006/EC (REACH), 1272/2008/EC (CLP), 29CFR1910/1200 and GHS Rev. 3

Effective date: 12.08.2015 **Revision** : 12.10.2015

Trade Name: Alconox

Additional information: None.

Hazard description

Hazards Not Otherwise Classified (HNOC): None

Information concerning particular hazards for humans and environment:

The product has to be labelled due to the calculation procedure of the "General Classification guideline for preparations of the EU" in the latest valid version.

Classification system:

The classification is according to EC regulation No. 1272/2008, 29CFR1910/1200 and GHS Rev. 3 and amendments, and extended by company and literature data. The classification is in accordance with the latest editions of international substances lists, and is supplemented by information from technical literature and by information provided by the company.

3 Composition/information on ingredients

3.1 Chemical characterization : None

3.2 Description : None

3.3 Hazardous components (percentages by weight)

Identification	Chemical Name	Classification	Wt. %
CAS number: 7758-29-4	Sodium tripolyphosphate	Skin Irrit. 2 ; H315 Eye Irrit. 2; H319	12-28
CAS number: 68081-81-2	Sodium Alkylbenzene Sulfonate	Acute Tox. 4; H303 Skin Irrit. 2 ; H315 Eye Irrit. 2; H319	8-22
CAS number: 7722-88-5	Tetrasodium Pyrophosphate	Skin Irrit. 2 ; H315 Eye Irrit. 2; H319	2-16

3.4 Additional Information : None.

4 First aid measures

4.1 Description of first aid measures

General information: None.

After inhalation:

Maintain an unobstructed airway.

Loosen clothing as necessary and position individual in a comfortable position.

After skin contact:

Wash affected area with soap and water.

Seek medical attention if symptoms develop or persist.

After eye contact:

Rinse/flush exposed eye(s) gently using water for 15-20 minutes.

Remove contact lens(es) if able to do so during rinsing.

Seek medical attention if irritation persists or if concerned.

After swallowing:

Rinse mouth thoroughly.

Seek medical attention if irritation, discomfort, or vomiting persists.

Safety Data Sheet

according to 1907/2006/EC (REACH), 1272/2008/EC (CLP), 29CFR1910/1200 and GHS Rev. 3

Effective date: 12.08.2015 **Revision** : 12.10.2015

Trade Name: Alconox

4.2 Most important symptoms and effects, both acute and delayed

None

4.3 Indication of any immediate medical attention and special treatment needed:

No additional information.

5 Firefighting measures

5.1 Extinguishing media

Suitable extinguishing agents:

Use appropriate fire suppression agents for adjacent combustible materials or sources of ignition.

For safety reasons unsuitable extinguishing agents : None

5.2 Special hazards arising from the substance or mixture :

Thermal decomposition can lead to release of irritating gases and vapors.

5.3 Advice for firefighters

Protective equipment:

Wear protective eye wear, gloves and clothing.
Refer to Section 8.

5.4 Additional information :

Avoid inhaling gases, fumes, dust, mist, vapor and aerosols.
Avoid contact with skin, eyes and clothing.

6 Accidental release measures

6.1 Personal precautions, protective equipment and emergency procedures :

Ensure adequate ventilation.
Ensure air handling systems are operational.

6.2 Environmental precautions :

Should not be released into the environment.
Prevent from reaching drains, sewer or waterway.

6.3 Methods and material for containment and cleaning up :

Wear protective eye wear, gloves and clothing.

6.4 Reference to other sections : None

7 Handling and storage

7.1 Precautions for safe handling :

Avoid breathing mist or vapor.
Do not eat, drink, smoke or use personal products when handling chemical substances.

7.2 Conditions for safe storage, including any incompatibilities :

Store in a cool, well-ventilated area.

7.3 Specific end use(s):

No additional information.

Safety Data Sheet

according to 1907/2006/EC (REACH), 1272/2008/EC (CLP), 29CFR1910/1200 and GHS Rev. 3

Effective date: 12.08.2015 **Revision** : 12.10.2015

Trade Name: Alconox

8 Exposure controls/personal protection

8.1 Control parameters :

7722-88-5, Tetrasodium Pyrophosphate, OSHA TWA 5 mg/m3.

8.2 Exposure controls

Appropriate engineering controls:

Emergency eye wash fountains and safety showers should be available in the immediate vicinity of use or handling.

Respiratory protection:

Not needed under normal conditions.

Protection of skin:

Select glove material impermeable and resistant to the substance.

Eye protection:

Safety goggles or glasses, or appropriate eye protection.

General hygienic measures:

Wash hands before breaks and at the end of work.
Avoid contact with skin, eyes and clothing.

9 Physical and chemical properties

Appearance (physical state, color):	White and cream colored flakes - powder	**Explosion limit lower:** **Explosion limit upper:**	Not determined or not available. Not determined or not available.
Odor:	Not determined or not available.	**Vapor pressure at 20°C:**	Not determined or not available.
Odor threshold:	Not determined or not available.	**Vapor density:**	Not determined or not available.
pH-value:	9.5 (aqueous solution)	**Relative density:**	Not determined or not available.
Melting/Freezing point:	Not determined or not available.	**Solubilities:**	Not determined or not available.
Boiling point/Boiling range:	Not determined or not available.	**Partition coefficient (n-octanol/water):**	Not determined or not available.
Flash point (closed cup):	Not determined or not available.	**Auto/Self-ignition temperature:**	Not determined or not available.
Evaporation rate:	Not determined or not available.	**Decomposition temperature:**	Not determined or not available.

Safety Data Sheet

according to 1907/2006/EC (REACH), 1272/2008/EC (CLP), 29CFR1910/1200 and GHS Rev. 3

Effective date: 12.08.2015 **Revision** : 12.10.2015

Trade Name: Alconox

Flammability (solid, gaseous):	Not determined or not available.	**Viscosity**:	a. Kinematic: Not determined or not available. b. Dynamic: Not determined or not available.
Density at 20°C:	Not determined or not available.		

10 Stability and reactivity

10.1 Reactivity : None

10.2 Chemical stability : None

10.3 Possibility hazardous reactions : None

10.4 Conditions to avoid : None

10.5 Incompatible materials : None

10.6 Hazardous decomposition products : None

11 Toxicological information

11.1 Information on toxicological effects :

Acute Toxicity:

Oral:

: LD50 > 5000 mg/kg oral rat - Product .

Chronic Toxicity: No additional information.

Skin corrosion/irritation:

Sodium Alkylbenzene Sulfonate: Causes skin irritation. .

Serious eye damage/irritation:

Sodium Alkylbenzene Sulfonate: Causes serious eye irritation .

Tetrasodium Pyrophosphate: Rabbit - Risk of serious damage to eyes .

Respiratory or skin sensitization: No additional information.

Carcinogenicity: No additional information.

IARC (International Agency for Research on Cancer): None of the ingredients are listed.

NTP (National Toxicology Program): None of the ingredients are listed.

Germ cell mutagenicity: No additional information.

Reproductive toxicity: No additional information.

STOT-single and repeated exposure: No additional information.

Additional toxicological information: No additional information.

12 Ecological information

Safety Data Sheet

according to 1907/2006/EC (REACH), 1272/2008/EC (CLP), 29CFR1910/1200 and GHS Rev. 3

Effective date: 12.08.2015 **Revision** : 12.10.2015

Trade Name: Alconox

12.1 Toxicity:

Sodium Alkylbenzene Sulfonate: Fish, LC50 1.67 mg/l, 96 hours.
Sodium Alkylbenzene Sulfonate: Aquatic invertebrates, EC50 Daphnia 2.4 mg/l, 48 hours.
Sodium Alkylbenzene Sulfonate: Aquatic Plants, EC50 Algae 29 mg/l, 96 hours.
Tetrasodium Pyrophosphate: Fish, LC50 - other fish - 1,380 mg/l - 96 h.
Tetrasodium Pyrophosphate: Aquatic invertebrates, EC50 - Daphnia magna (Water flea) - 391 mg/l - 48 h.

12.2 Persistence and degradability: No additional information.

12.3 Bioaccumulative potential: No additional information.

12.4 Mobility in soil: No additional information.

General notes: No additional information.

12.5 Results of PBT and vPvB assessment:

PBT: No additional information.

vPvB: No additional information.

12.6 Other adverse effects: No additional information.

13 Disposal considerations

13.1 Waste treatment methods (consult local, regional and national authorities for proper disposal)

Relevant Information:

It is the responsibility of the waste generator to properly characterize all waste materials according to applicable regulatory entities. (US 40CFR262.11).

14 Transport information

14.1 UN Number: None
ADR, ADN, DOT, IMDG, IATA

14.2 UN Proper shipping name: None
ADR, ADN, DOT, IMDG, IATA

14.3 Transport hazard classes:
ADR, ADN, DOT, IMDG, IATA

Class: None
Label: None
LTD. QTY: None

US DOT
Limited Quantity Exception: None

Bulk:
RQ (if applicable): None
Proper shipping Name: None
Hazard Class: None
Packing Group: None
Marine Pollutant (if applicable): No additional information.

Non Bulk:
RQ (if applicable): None
Proper shipping Name: None
Hazard Class: None
Packing Group: None
Marine Pollutant (if applicable): No additional information.

Safety Data Sheet

according to 1907/2006/EC (REACH), 1272/2008/EC (CLP), 29CFR1910/1200 and GHS Rev. 3

Effective date: 12.08.2015 **Revision** : 12.10.2015

Trade Name: Alconox

Comments: None	**Comments:** None
14.4 Packing group: ADR, ADN, DOT, IMDG, IATA	None
14.5 Environmental hazards :	None
14.6 Special precautions for user:	None
Danger code (Kemler):	None
EMS number:	None
Segregation groups:	None

14.7 Transport in bulk according to Annex II of MARPOL73/78 and the IBC Code: Not applicable.

14.8 Transport/Additional information:

Transport category:	None
Tunnel restriction code:	None
UN "Model Regulation":	None

15 Regulatory information

15.1 Safety, health and environmental regulations/legislation specific for the substance or mixture.

North American

SARA

Section 313 (specific toxic chemical listings): None of the ingredients are listed.
Section 302 (extremely hazardous substances): None of the ingredients are listed.

CERCLA (Comprehensive Environmental Response, Clean up and Liability Act) Reportable

Spill Quantity: None of the ingredients are listed.

TSCA (Toxic Substances Control Act):

Inventory: All ingredients are listed.
Rules and Orders: Not applicable.

Proposition 65 (California):

Chemicals known to cause cancer: None of the ingredients are listed.

Chemicals known to cause reproductive toxicity for females: None of the ingredients are listed.

Chemicals known to cause reproductive toxicity for males: None of the ingredients are listed.

Chemicals known to cause developmental toxicity: None of the ingredients are listed.

Canadian

Canadian Domestic Substances List (DSL):
All ingredients are listed.

EU

REACH Article 57 (SVHC): None of the ingredients are listed.

Safety Data Sheet

according to 1907/2006/EC (REACH), 1272/2008/EC (CLP), 29CFR1910/1200 and GHS Rev. 3

Effective date: 12.08.2015 **Revision** : 12.10.2015

Trade Name: Alconox

Germany MAK: Not classified.

Asia Pacific

Australia

Australian Inventory of Chemical Substances (AICS): All ingredients are listed.

China

Inventory of Existing Chemical Substances in China (IECSC): All ingredients are listed.

Japan

Inventory of Existing and New Chemical Substances (ENCS): All ingredients are listed.

Korea

Existing Chemicals List (ECL): All ingredients are listed.

New Zealand

New Zealand Inventory of Chemicals (NZOIC): All ingredients are listed.

Philippines

Philippine Inventory of Chemicals and Chemical Substances (PICCS): All ingredients are listed.

Taiwan

Taiwan Chemical Substance Inventory (TSCI): All ingredients are listed.

16 Other information

Abbreviations and Acronyms: None

Summary of Phrases

Hazard statements:

H315 Causes skin irritation.
H319 Causes serious eye irritation.

Precautionary statements:

P264 Wash skin thoroughly after handling.
P280 Wear protective gloves/protective clothing/eye protection/face protection.
P302+P352 If on skin: Wash with soap and water.
P305+P351+P338 If in eyes: Rinse cautiously with water for several minutes. Remove contact lenses if present and easy to do. Continue rinsing.
P321 Specific treatment (see supplemental first aid instructions on this label).
P332+P313 If skin irritation occurs: Get medical advice/attention.
P362 Take off contaminated clothing and wash before reuse.
P501 Dispose of contents and container as instructed in Section 13.

Manufacturer Statement:

The information provided in this Safety Data Sheet is correct to the best of our knowledge, information and belief at the date of its publication. The information given is designed only as guidance for safe handling, use, processing, storage, transportation, disposal and release and is not to be considered a warranty or quality specification. The information relates only to the specific material designated and may not be valid for such material used in combination with any other materials or in any process, unless specified in the text.

NFPA: 1-0-0

Safety Data Sheet

according to 1907/2006/EC (REACH), 1272/2008/EC (CLP), 29CFR1910/1200 and GHS Rev. 3

Effective date: 12.08.2015 **Revision** : 12.10.2015

Trade Name: Alconox

HMIS: 1-0-0

Material Safety Data Sheet

Helium

Section 1. Chemical product and company identification

Product name : Helium

Supplier : AIRGAS INC., on behalf of its subsidiaries
259 North Radnor-Chester Road
Suite 100
Radnor, PA 19087-5283
1-610-687-5253

Product use : Synthetic/Analytical chemistry.

Synonym : helium (dot); Helium-4; He; o-Helium; UN 1046; UN 1963; Liquid Helium; Helium, Refrigerated Liquid

MSDS # : 001025

Date of Preparation/Revision : **8/27/2010.**

In case of emergency : 1-866-734-3438

Section 2. Hazards identification

Physical state : Gas. [Colorless, Odorless Gas, Cryogenic liquid and gas]

Emergency overview : WARNING!

GAS:
CONTENTS UNDER PRESURE.
Do not puncture or incinerate container.
Can cause rapid suffocation.
May cause severe frostbite.
LIQUID:
Extremely cold liquid and gas under pressure.
Can cause rapid suffocation.
May cause severe frostbite.

Do not puncture or incinerate container.

Contact with rapidly expanding gases or liquids can cause frostbite.

Routes of entry : Inhalation

Potential acute health effects

Eyes : Contact with rapidly expanding gas may cause burns or frostbite. Contact with cryogenic liquid can cause frostbite and cryogenic burns.

Skin : Contact with rapidly expanding gas may cause burns or frostbite. Contact with cryogenic liquid can cause frostbite and cryogenic burns.

Inhalation : Acts as a simple asphyxiant.

Ingestion : Ingestion is not a normal route of exposure for gases. Contact with cryogenic liquid can cause frostbite and cryogenic burns.

Potential chronic health effects : **CARCINOGENIC EFFECTS**: Not available.
MUTAGENIC EFFECTS: Not available.
TERATOGENIC EFFECTS: Not available.

Medical conditions aggravated by over-exposure : Acute or chronic respiratory conditions may be aggravated by overexposure to this gas.

See toxicological information (section 11)

Section 3. Composition, Information on Ingredients

Name	CAS number	% Volume	Exposure limits
Helium	7440-59-7	100	Oxygen Depletion [Asphyxiant]

Section 4. First aid measures

No action shall be taken involving any personal risk or without suitable training.If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus.It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation.

Eye contact : Check for and remove any contact lenses. Immediately flush eyes with plenty of water for at least 15 minutes, occasionally lifting the upper and lower eyelids. Get medical attention immediately.

Skin contact : None expected.

Frostbite : Try to warm up the frozen tissues and seek medical attention.

Inhalation : Move exposed person to fresh air. If not breathing, if breathing is irregular or if respiratory arrest occurs, provide artificial respiration or oxygen by trained personnel. Loosen tight clothing such as a collar, tie, belt or waistband. Get medical attention immediately.

Ingestion : As this product is a gas, refer to the inhalation section.

Section 5. Fire-fighting measures

Flammability of the product : Non-flammable.

Products of combustion : No specific data.

Fire-fighting media and instructions : Use an extinguishing agent suitable for the surrounding fire.

Apply water from a safe distance to cool container and protect surrounding area. If involved in fire, shut off flow immediately if it can be done without risk.

Contains gas under pressure. In a fire or if heated, a pressure increase will occur and the container may burst or explode.

Special protective equipment for fire-fighters : Fire-fighters should wear appropriate protective equipment and self-contained breathing apparatus (SCBA) with a full face-piece operated in positive pressure mode.

Section 6. Accidental release measures

Personal precautions : Immediately contact emergency personnel. Keep unnecessary personnel away. Use suitable protective equipment (section 8). Shut off gas supply if this can be done safely. Isolate area until gas has dispersed.

Environmental precautions : Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers.

Methods for cleaning up : Immediately contact emergency personnel. Stop leak if without risk. Note: see section 1 for emergency contact information and section 13 for waste disposal.

Section 7. Handling and storage

Handling : High pressure gas. Do not puncture or incinerate container. Use equipment rated for cylinder pressure. Close valve after each use and when empty. Protect cylinders from physical damage; do not drag, roll, slide, or drop. Use a suitable hand truck for cylinder movement.

Never allow any unprotected part of the body to touch uninsulated pipes or vessels that contain cryogenic liquids. Prevent entrapment of liquid in closed systems or piping without pressure relief devices. Some materials may become brittle at low temperatures and will easily fracture.

Storage : Cylinders should be stored upright, with valve protection cap in place, and firmly secured to prevent falling or being knocked over. Cylinder temperatures should not exceed 52 °C (125 °F).
For additional information concerning storage and handling refer to Compressed Gas Association pamphlets P-1 Safe Handling of Compressed Gases in Containers and P-12 Safe Handling of Cryogenic Liquids available from the Compressed Gas Association, Inc.

Section 8. Exposure controls/personal protection

Engineering controls : Use only with adequate ventilation. Use process enclosures, local exhaust ventilation or other engineering controls to keep worker exposure to airborne contaminants below any recommended or statutory limits.

Personal protection

Eyes : Safety eyewear complying with an approved standard should be used when a risk assessment indicates this is necessary to avoid exposure to liquid splashes, mists or dusts.

When working with cryogenic liquids, wear a full face shield.

Skin : Personal protective equipment for the body should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.

Respiratory : Use a properly fitted, air-purifying or air-fed respirator complying with an approved standard if a risk assessment indicates this is necessary. Respirator selection must be based on known or anticipated exposure levels, the hazards of the product and the safe working limits of the selected respirator.

The applicable standards are (US) 29 CFR 1910.134 and (Canada) Z94.4-93

Hands : Chemical-resistant, impervious gloves complying with an approved standard should be worn at all times when handling chemical products if a risk assessment indicates this is necessary.

Insulated gloves suitable for low temperatures

Personal protection in case of a large spill : Self-contained breathing apparatus (SCBA) should be used to avoid inhalation of the product.

Product name

helium	Oxygen Depletion [Asphyxiant]

Consult local authorities for acceptable exposure limits.

Section 9. Physical and chemical properties

Molecular weight : 4 g/mole

Molecular formula : He

Boiling/condensation point : -268.9°C (-452°F)

Melting/freezing point : -272.2°C (-458°F)

Critical temperature : -267.9°C (-450.2°F)

Vapor density : 0.14 (Air = 1) Liquid Density@BP: 7.8 lb/ft3 (125 kg/m3)

Specific Volume (ft ^{3}/lb) : 96.1538

Gas Density (lb/ft ^{3}) : 0.0104

Section 10. Stability and reactivity

Stability and reactivity : The product is stable.

Hazardous decomposition products : Under normal conditions of storage and use, hazardous decomposition products should not be produced.

Hazardous polymerization : Under normal conditions of storage and use, hazardous polymerization will not occur.

Section 11. Toxicological information

Toxicity data

Other toxic effects on humans : No specific information is available in our database regarding the other toxic effects of this material to humans.

Specific effects

Carcinogenic effects : No known significant effects or critical hazards.

Mutagenic effects : No known significant effects or critical hazards.

Reproduction toxicity : No known significant effects or critical hazards.

Section 12. Ecological information

Aquatic ecotoxicity

Not available.

Environmental fate : Not available.

Environmental hazards : No known significant effects or critical hazards.

Toxicity to the environment : Not available.

Section 13. Disposal considerations

Product removed from the cylinder must be disposed of in accordance with appropriate Federal, State, local regulation.Return cylinders with residual product to Airgas, Inc.Do not dispose of locally.

Section 14. Transport information

Regulatory information	UN number	Proper shipping name	Class	Packing group	Label	Additional information
DOT Classification	UN1046 UN1963	HELIUM, COMPRESSED Helium, refrigerated liquid	2.2	Not applicable (gas).		**Limited quantity** Yes. **Packaging instruction** **Passenger aircraft** Quantity limitation: 75 kg **Cargo aircraft** Quantity limitation: 150 kg
TDG Classification	UN1046 UN1963	HELIUM, COMPRESSED Helium, refrigerated liquid	2.2	Not applicable (gas).		**Explosive Limit and Limited Quantity Index** 0.125 **Passenger Carrying Road or Rail Index** 75

Helium						
Mexico Classification	UN1046 UN1963	HELIUM, COMPRESSED Helium, refrigerated liquid	2.2	Not applicable (gas).		-

"Refer to CFR 49 (or authority having jurisdiction) to determine the information required for shipment of the product."

Section 15. Regulatory information

United States

U.S. Federal regulations : **United States inventory (TSCA 8b):** This material is listed or exempted.

SARA 302/304/311/312 extremely hazardous substances: No products were found.
SARA 302/304 emergency planning and notification: No products were found.
SARA 302/304/311/312 hazardous chemicals: helium
SARA 311/312 MSDS distribution - chemical inventory - hazard identification: helium: Sudden release of pressure

Clean Water Act (CWA) 307: No products were found.

Clean Water Act (CWA) 311: No products were found.

Clean Air Act (CAA) 112 accidental release prevention: No products were found.

Clean Air Act (CAA) 112 regulated flammable substances: No products were found.

Clean Air Act (CAA) 112 regulated toxic substances: No products were found.

State regulations : **Connecticut Carcinogen Reporting:** This material is not listed.
Connecticut Hazardous Material Survey: This material is not listed.
Florida substances: This material is not listed.
Illinois Chemical Safety Act: This material is not listed.
Illinois Toxic Substances Disclosure to Employee Act: This material is not listed.
Louisiana Reporting: This material is not listed.
Louisiana Spill: This material is not listed.
Massachusetts Spill: This material is not listed.
Massachusetts Substances: This material is listed.
Michigan Critical Material: This material is not listed.
Minnesota Hazardous Substances: This material is not listed.
New Jersey Hazardous Substances: This material is listed.
New Jersey Spill: This material is not listed.
New Jersey Toxic Catastrophe Prevention Act: This material is not listed.
New York Acutely Hazardous Substances: This material is not listed.
New York Toxic Chemical Release Reporting: This material is not listed.
Pennsylvania RTK Hazardous Substances: This material is listed.
Rhode Island Hazardous Substances: This material is not listed.

Canada

WHMIS (Canada) : Class A: Compressed gas.

CEPA Toxic substances: This material is not listed.
Canadian ARET: This material is not listed.
Canadian NPRI: This material is not listed.
Alberta Designated Substances: This material is not listed.
Ontario Designated Substances: This material is not listed.
Quebec Designated Substances: This material is not listed.

Section 16. Other information

United States

Label requirements : GAS:
CONTENTS UNDER PRESURE.
Do not puncture or incinerate container.
Can cause rapid suffocation.
May cause severe frostbite.
LIQUID:
Extremely cold liquid and gas under pressure.
Can cause rapid suffocation.
May cause severe frostbite.

Canada

Label requirements : Class A: Compressed gas.

Hazardous Material Information System (U.S.A.) :

Health	1
Flammability	0
Physical hazards	0

liquid:

Health	3
Fire hazard	0
Reactivity	0
Personal protection	

National Fire Protection Association (U.S.A.) :

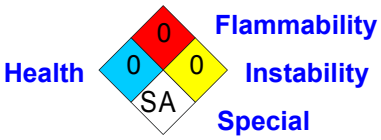

liquid:

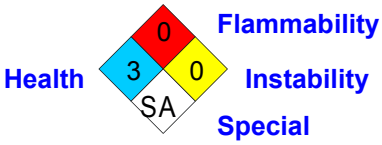

Notice to reader

To the best of our knowledge, the information contained herein is accurate. However, neither the above-named supplier, nor any of its subsidiaries, assumes any liability whatsoever for the accuracy or completeness of the information contained herein.
Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards that exist.

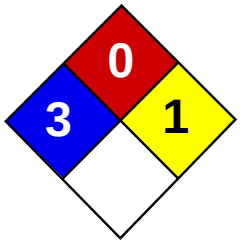

Material Safety Data Sheet
Hydrochloric acid MSDS

Section 1: Chemical Product and Company Identification

Product Name: Hydrochloric acid

Catalog Codes: SLH1462, SLH3154

CAS#: Mixture.

RTECS: MW4025000

TSCA: TSCA 8(b) inventory: Hydrochloric acid

CI#: Not applicable.

Synonym: Hydrochloric Acid; Muriatic Acid

Chemical Name: Not applicable.

Chemical Formula: Not applicable.

Contact Information:

Sciencelab.com, Inc.
14025 Smith Rd.
Houston, Texas 77396

US Sales: **1-800-901-7247**
International Sales: **1-281-441-4400**

Order Online: ScienceLab.com

CHEMTREC (24HR Emergency Telephone), call:
1-800-424-9300

International CHEMTREC, call: 1-703-527-3887

For non-emergency assistance, call: 1-281-441-4400

Section 2: Composition and Information on Ingredients

Composition:

Name	CAS #	% by Weight
Hydrogen chloride	7647-01-0	20-38
Water	7732-18-5	62-80

Toxicological Data on Ingredients: Hydrogen chloride: GAS (LC50): Acute: 4701 ppm 0.5 hours [Rat].

Section 3: Hazards Identification

Potential Acute Health Effects:
Very hazardous in case of skin contact (corrosive, irritant, permeator), of eye contact (irritant, corrosive), of ingestion, . Slightly hazardous in case of inhalation (lung sensitizer). Non-corrosive for lungs. Liquid or spray mist may produce tissue damage particularly on mucous membranes of eyes, mouth and respiratory tract. Skin contact may produce burns. Inhalation of the spray mist may produce severe irritation of respiratory tract, characterized by coughing, choking, or shortness of breath. Severe over-exposure can result in death. Inflammation of the eye is characterized by redness, watering, and itching. Skin inflammation is characterized by itching, scaling, reddening, or, occasionally, blistering.

Potential Chronic Health Effects:
Slightly hazardous in case of skin contact (sensitizer). CARCINOGENIC EFFECTS: Classified 3 (Not classifiable for human.) by IARC [Hydrochloric acid]. MUTAGENIC EFFECTS: Not available. TERATOGENIC EFFECTS: Not available. DEVELOPMENTAL TOXICITY: Not available. The substance may be toxic to kidneys, liver, mucous membranes, upper respiratory tract, skin, eyes, Circulatory System, teeth. Repeated or prolonged exposure to the substance can produce target

organs damage. Repeated or prolonged contact with spray mist may produce chronic eye irritation and severe skin irritation. Repeated or prolonged exposure to spray mist may produce respiratory tract irritation leading to frequent attacks of bronchial infection. Repeated exposure to a highly toxic material may produce general deterioration of health by an accumulation in one or many human organs.

Section 4: First Aid Measures

Eye Contact:
Check for and remove any contact lenses. In case of contact, immediately flush eyes with plenty of water for at least 15 minutes. Cold water may be used. Get medical attention immediately.

Skin Contact:
In case of contact, immediately flush skin with plenty of water for at least 15 minutes while removing contaminated clothing and shoes. Cover the irritated skin with an emollient. Cold water may be used.Wash clothing before reuse. Thoroughly clean shoes before reuse. Get medical attention immediately.

Serious Skin Contact:
Wash with a disinfectant soap and cover the contaminated skin with an anti-bacterial cream. Seek immediate medical attention.

Inhalation:
If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention immediately.

Serious Inhalation:
Evacuate the victim to a safe area as soon as possible. Loosen tight clothing such as a collar, tie, belt or waistband. If breathing is difficult, administer oxygen. If the victim is not breathing, perform mouth-to-mouth resuscitation. WARNING: It may be hazardous to the person providing aid to give mouth-to-mouth resuscitation when the inhaled material is toxic, infectious or corrosive. Seek immediate medical attention.

Ingestion:
If swallowed, do not induce vomiting unless directed to do so by medical personnel. Never give anything by mouth to an unconscious person. Loosen tight clothing such as a collar, tie, belt or waistband. Get medical attention immediately.

Serious Ingestion: Not available.

Section 5: Fire and Explosion Data

Flammability of the Product: Non-flammable.

Auto-Ignition Temperature: Not applicable.

Flash Points: Not applicable.

Flammable Limits: Not applicable.

Products of Combustion: Not available.

Fire Hazards in Presence of Various Substances: of metals

Explosion Hazards in Presence of Various Substances: Non-explosive in presence of open flames and sparks, of shocks.

Fire Fighting Media and Instructions: Not applicable.

Special Remarks on Fire Hazards:
Non combustible. Calcium carbide reacts with hydrogen chloride gas with incandescence. Uranium phosphide reacts with hydrochloric acid to release spontaneously flammable phosphine. Rubidium acetylene carbides burns with slightly warm hydrochloric acid. Lithium silicide in contact with hydrogen chloride becomes incandescent. When dilute hydrochloric acid is used, gas spontaneously flammable in air is evolved. Magnesium boride treated with concentrated hydrochloric acid produces spontaneously flammble gas. Cesium acetylene carbide burns hydrogen chloride gas. Cesium carbide ignites in contact with hydrochloric acid unless acid is dilute. Reacts with most metals to produce flammable Hydrodgen gas.

Special Remarks on Explosion Hazards:

Hydrogen chloride in contact with the following can cause an explosion, ignition on contact, or other violent/vigorous reaction: Acetic anhydride AgClO + CCl4 Alcohols + hydrogen cyanide, Aluminum Aluminum-titanium alloys (with HCl vapor), 2-Amino ethanol, Ammonium hydroxide, Calcium carbide Ca3P2 Chlorine + dinitroanilines (evolves gas), Chlorosulfonic acid Cesium carbide Cesium acetylene carbide, 1,1-Difluoroethylene Ethylene diamine Ethylene imine, Fluorine, HClO4 Hexalithium disilicide H2SO4 Metal acetylides or carbides, Magnesium boride, Mercuric sulfate, Oleum, Potassium permanganate, beta-Propiolactone Propylene oxide Rubidium carbide, Rubidium, acetylene carbide Sodium (with aqueous HCl), Sodium hydroxide Sodium tetraselenium, Sulfonic acid, Tetraselenium tetranitride, U3P4 , Vinyl acetate. Silver perchlorate with carbon tetrachloride in the presence of hydrochloric acid produces trichloromethyl perchlorate which detonates at 40 deg. C.

Section 6: Accidental Release Measures

Small Spill:
Dilute with water and mop up, or absorb with an inert dry material and place in an appropriate waste disposal container. If necessary: Neutralize the residue with a dilute solution of sodium carbonate.

Large Spill:
Corrosive liquid. Poisonous liquid. Stop leak if without risk. Absorb with DRY earth, sand or other non-combustible material. Do not get water inside container. Do not touch spilled material. Use water spray curtain to divert vapor drift. Use water spray to reduce vapors. Prevent entry into sewers, basements or confined areas; dike if needed. Call for assistance on disposal. Neutralize the residue with a dilute solution of sodium carbonate. Be careful that the product is not present at a concentration level above TLV. Check TLV on the MSDS and with local authorities.

Section 7: Handling and Storage

Precautions:
Keep locked up.. Keep container dry. Do not ingest. Do not breathe gas/fumes/ vapor/spray. Never add water to this product. In case of insufficient ventilation, wear suitable respiratory equipment. If ingested, seek medical advice immediately and show the container or the label. Avoid contact with skin and eyes. Keep away from incompatibles such as oxidizing agents, organic materials, metals, alkalis, moisture. May corrode metallic surfaces. Store in a metallic or coated fiberboard drum using a strong polyethylene inner package.

Storage: Keep container tightly closed. Keep container in a cool, well-ventilated area.

Section 8: Exposure Controls/Personal Protection

Engineering Controls:
Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapors below their respective threshold limit value. Ensure that eyewash stations and safety showers are proximal to the work-station location.

Personal Protection:
Face shield. Full suit. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Gloves. Boots.

Personal Protection in Case of a Large Spill:
Splash goggles. Full suit. Vapor respirator. Boots. Gloves. A self contained breathing apparatus should be used to avoid inhalation of the product. Suggested protective clothing might not be sufficient; consult a specialist BEFORE handling this product.

Exposure Limits:
CEIL: 5 (ppm) from OSHA (PEL) [United States] CEIL: 7 (mg/m3) from OSHA (PEL) [United States] CEIL: 5 from NIOSH CEIL: 7 (mg/m3) from NIOSH TWA: 1 STEL: 5 (ppm) [United Kingdom (UK)] TWA: 2 STEL: 8 (mg/m3) [United Kingdom (UK)]Consult local authorities for acceptable exposure limits.

Section 9: Physical and Chemical Properties

Physical state and appearance: Liquid.

Odor: Pungent. Irritating (Strong.)

Taste: Not available.

Molecular Weight: Not applicable.

Color: Colorless to light yellow.

pH (1% soln/water): Acidic.

Boiling Point:
108.58 C @ 760 mm Hg (for 20.22% HCl in water) 83 C @ 760 mm Hg (for 31% HCl in water) 50.5 C (for 37% HCl in water)

Melting Point:
-62.25°C (-80°F) (20.69% HCl in water) -46.2 C (31.24% HCl in water) -25.4 C (39.17% HCl in water)

Critical Temperature: Not available.

Specific Gravity:
1.1- 1.19 (Water = 1) 1.10 (20%and 22% HCl solutions) 1.12 (24% HCl solution) 1.15 (29.57% HCl solution) 1.16 (32% HCl solution) 1.19 (37% and 38%HCl solutions)

Vapor Pressure: 16 kPa (@ 20°C) average

Vapor Density: 1.267 (Air = 1)

Volatility: Not available.

Odor Threshold: 0.25 to 10 ppm

Water/Oil Dist. Coeff.: Not available.

Ionicity (in Water): Not available.

Dispersion Properties: See solubility in water, diethyl ether.

Solubility: Soluble in cold water, hot water, diethyl ether.

Section 10: Stability and Reactivity Data

Stability: The product is stable.

Instability Temperature: Not available.

Conditions of Instability: Incompatible materials, water

Incompatibility with various substances:
Highly reactive with metals. Reactive with oxidizing agents, organic materials, alkalis, water.

Corrosivity:
Extremely corrosive in presence of aluminum, of copper, of stainless steel(304), of stainless steel(316). Non-corrosive in presence of glass.

Special Remarks on Reactivity:
Reacts with water especially when water is added to the product. Absorption of gaseous hydrogen chloride on mercuric sulfate becomes violent @ 125 deg. C. Sodium reacts very violently with gaseous hydrogen chloride. Calcium phosphide and hydrochloric acid undergo very energetic reaction. It reacts with oxidizers releasing chlorine gas. Incompatible with, alkali metals, carbides, borides, metal oxides, vinyl acetate, acetylides, sulphides, phosphides, cyanides, carbonates. Reacts with most metals to produce flammable Hydrogen gas. Reacts violently (moderate reaction with heat of evolution) with water especially when water is added to the product. Isolate hydrogen chloride from heat, direct sunlight, alkalies (reacts vigorously), organic materials, and oxidizers (especially nitric acid and chlorates), amines, metals, copper and alloys (e.g. brass), hydroxides, zinc (galvanized materials), lithium silicide (incandescence), sulfuric acid(increase in temperature and pressure) Hydrogen chloride gas is emitted when this product is in contact with sulfuric acid. Adsorption of Hydrochloric Acid onto silicon dioxide results in exothmeric reaction. Hydrogen chloride causes aldehydes and epoxides to violently polymerize. Hydrogen chloride or Hydrochloric Acid in contact with the folloiwng can cause explosion or ignition on contact or

Special Remarks on Corrosivity:

Highly corrosive. Incompatible with copper and copper alloys. It attacks nearly all metals (mercury, gold, platinium, tantalum, silver, and certain alloys are exceptions). It is one of the most corrosive of the nonoxidizing acids in contact with copper alloys. No corrosivity data on zinc, steel. Severe Corrosive effect on brass and bronze

Polymerization: Will not occur.

Section 11: Toxicological Information

Routes of Entry: Absorbed through skin. Dermal contact. Eye contact. Inhalation.

Toxicity to Animals:
Acute oral toxicity (LD50): 900 mg/kg [Rabbit]. Acute toxicity of the vapor (LC50): 1108 ppm, 1 hours [Mouse]. Acute toxicity of the vapor (LC50): 3124 ppm, 1 hours [Rat].

Chronic Effects on Humans:
CARCINOGENIC EFFECTS: Classified 3 (Not classifiable for human.) by IARC [Hydrochloric acid]. May cause damage to the following organs: kidneys, liver, mucous membranes, upper respiratory tract, skin, eyes, Circulatory System, teeth.

Other Toxic Effects on Humans:
Very hazardous in case of skin contact (corrosive, irritant, permeator), of ingestion, . Hazardous in case of eye contact (corrosive), of inhalation (lung corrosive).

Special Remarks on Toxicity to Animals:
Lowest Published Lethal Doses (LDL/LCL) LDL [Man] -Route: Oral; 2857 ug/kg LCL [Human] - Route: Inhalation; Dose: 1300 ppm/30M LCL [Rabbit] - Route: Inhalation; Dose: 4413 ppm/30M

Special Remarks on Chronic Effects on Humans:
May cause adverse reproductive effects (fetoxicity). May affect genetic material.

Special Remarks on other Toxic Effects on Humans:
Acute Potential Health Effects: Skin: Corrosive. Causes severe skin irritation and burns. Eyes: Corrosive. Causes severe eye irritation/conjuntivitis, burns, corneal necrosis. Inhalation: May be fatal if inhaled. Material is extremely destructive to tissue of the mucous membranes and upper respiratory tract. Inhalation of hydrochloric acid fumes produces nose, throat, and larryngeal burning, and irritation, pain and inflammation, coughing, sneezing, choking sensation, hoarseness, laryngeal spasms, upper respiratory tract edema, chest pains, as well has headache, and palpitations. Inhalation of high concentrations can result in corrosive burns, necrosis of bronchial epithelium, constriction of the larynx and bronchi, nasospetal perforation, glottal closure, occur, particularly if exposure is prolonged. May affect the liver. Ingestion: May be fatal if swallowed. Causes irritation and burning, ulceration, or perforation of the gastrointestinal tract and resultant peritonitis, gastric hemorrhage and infection. Can also cause nausea, vomitting (with "coffee ground" emesis), diarrhea, thirst, difficulty swallowing, salivation, chills, fever, uneasiness, shock, strictures and stenosis (esophogeal, gastric, pyloric). May affect behavior (excitement), the cardiovascular system (weak rapid pulse, tachycardia), respiration (shallow respiration), and urinary system (kidneys- renal failure, nephritis). Acute exposure via inhalation or ingestion can also cause erosion of tooth enamel. Chronic Potential Health Effects: dyspnea, bronchitis. Chemical pneumonitis and pulmonary edema can also

Section 12: Ecological Information

Ecotoxicity: Not available.

BOD5 and COD: Not available.

Products of Biodegradation:
Possibly hazardous short term degradation products are not likely. However, long term degradation products may arise.

Toxicity of the Products of Biodegradation: The products of degradation are less toxic than the product itself.

Special Remarks on the Products of Biodegradation: Not available.

Section 13: Disposal Considerations

Waste Disposal:

Waste must be disposed of in accordance with federal, state and local environmental control regulations.

Section 14: Transport Information

DOT Classification: Class 8: Corrosive material

Identification: : Hydrochloric acid, solution UNNA: 1789 PG: II

Special Provisions for Transport: Not available.

Section 15: Other Regulatory Information

Federal and State Regulations:
Connecticut hazardous material survey.: Hydrochloric acid Illinois toxic substances disclosure to employee act: Hydrochloric acid Illinois chemical safety act: Hydrochloric acid New York release reporting list: Hydrochloric acid Rhode Island RTK hazardous substances: Hydrochloric acid Pennsylvania RTK: Hydrochloric acid Minnesota: Hydrochloric acid Massachusetts RTK: Hydrochloric acid Massachusetts spill list: Hydrochloric acid New Jersey: Hydrochloric acid New Jersey spill list: Hydrochloric acid Louisiana RTK reporting list: Hydrochloric acid Louisiana spill reporting: Hydrochloric acid California Director's List of Hazardous Substances: Hydrochloric acid TSCA 8(b) inventory: Hydrochloric acid TSCA 4(a) proposed test rules: Hydrochloric acid SARA 302/304/311/312 extremely hazardous substances: Hydrochloric acid SARA 313 toxic chemical notification and release reporting: Hydrochloric acid CERCLA: Hazardous substances.: Hydrochloric acid: 5000 lbs. (2268 kg)

Other Regulations:
OSHA: Hazardous by definition of Hazard Communication Standard (29 CFR 1910.1200). EINECS: This product is on the European Inventory of Existing Commercial Chemical Substances.

Other Classifications:

WHMIS (Canada):
CLASS D-2A: Material causing other toxic effects (VERY TOXIC). CLASS E: Corrosive liquid.

DSCL (EEC):
R34- Causes burns. R37- Irritating to respiratory system. S26- In case of contact with eyes, rinse immediately with plenty of water and seek medical advice. S45- In case of accident or if you feel unwell, seek medical advice immediately (show the label where possible).

HMIS (U.S.A.):

Health Hazard: 3

Fire Hazard: 0

Reactivity: 1

Personal Protection:

National Fire Protection Association (U.S.A.):

Health: 3

Flammability: 0

Reactivity: 1

Specific hazard:

Protective Equipment:
Gloves. Full suit. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate. Face shield.

Section 16: Other Information

References:
-Hawley, G.G.. The Condensed Chemical Dictionary, 11e ed., New York N.Y., Van Nostrand Reinold, 1987. -SAX, N.I. Dangerous Properties of Indutrial Materials. Toronto, Van Nostrand Reinold, 6e ed. 1984. -The Sigma-Aldrich Library of Chemical Safety Data, Edition II. -Guide de la loi et du règlement sur le transport des marchandises dangeureuses au canada. Centre de conformité internatinal Ltée. 1986.

Other Special Considerations: Not available.

Created: 10/09/2005 05:45 PM

Last Updated: 05/21/2013 12:00 PM

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no event shall ScienceLab.com be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if ScienceLab.com has been advised of the possibility of such damages.

MATERIAL SAFETY DATA SHEET

Prepared to U.S. OSHA, CMA, ANSI and Canadian WHMIS Standards

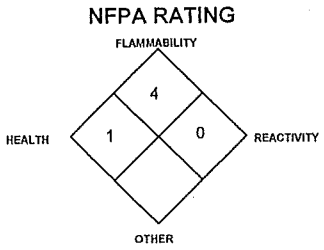

PART I *What is the material and what do I need to know in an emergency?*

1. PRODUCT IDENTIFICATION

CHEMICAL NAME; CLASS:	**ISOBUTYLENE - C_4H_8** Document Number: Isobutylene
PRODUCT USE:	For general analytical/synthetic chemical uses.
SUPPLIER/MANUFACTURER'S NAME: ADDRESS:	MESA Specialty Gases & Equipment 3619 Pendleton Avenue, Suite C Santa Ana, CA 92704
BUSINESS PHONE: EMERGENCY PHONE:	1-714-434-7102 INFOTRAC: 1-800-535-5053
DATE OF PREPARATION:	May 10, 1999

2. COMPOSITION and INFORMATION ON INGREDIENTS

CHEMICAL NAME	CAS #	mole %	EXPOSURE LIMITS IN AIR					
			ACGIH		OSHA			
			TLV ppm	STEL ppm	PEL ppm	STEL ppm	IDLH ppm	OTHER
Isobutylene	115-11-7	> 99.0%	There are no specific exposure limits for Isobutylene. Isobutylene is a simple asphyxiant (SA). Oxygen levels should be maintained above 19.5%.					
Maximum Impurities		< 1.0%	None of the trace impurities in this mixture contribute significantly to the hazards associated with the product. All hazard information pertinent to this product has been provided in this Material Safety Data Sheet, per the requirements of the OSHA Hazard Communication Standard (29 CFR 1910.1200) and State equivalent standards.					

NE = Not Established C = Ceiling Limit See Section 16 for Definitions of Terms Used

NOTE: All WHMIS required information is included. It is located in appropriate sections based on the ANSI Z400.1-1993 format.

3. HAZARD IDENTIFICATION

EMERGENCY OVERVIEW: Isobutylene is a colorless, liquefied, flammable gas with an unpleasant odor similar to burning coal. The liquefied gas rapidly turns into a gas at standard atmospheric temperatures and pressures. Isobutylene is an asphyxiant and presents a significant health hazard by displacing the oxygen in the atmosphere. Rapid evaporation of liquid from the cylinder may cause frostbite. Both the liquid and gas pose a serious fire hazard when accidentally released. The gas is heavier than air and may travel to a source of ignition and flash back to a leak or open container. Flame or high temperature impinging on a localized area of a cylinder of Isobutylene can cause the cylinder to rupture without activating the cylinder's relief devices. Provide adequate fire protection during emergency response situations.

SYMPTOMS OF OVEREXPOSURE BY ROUTE OF EXPOSURE: The most significant route of overexposure for this gas is by inhalation. The following paragraphs describe symptoms of exposure by route of exposure.

INHALATION: High concentrations of this gas can cause an oxygen-deficient environment. Individuals breathing such an atmosphere may experience symptoms which include headaches, ringing in ears, dizziness, drowsiness, unconsciousness, nausea, vomiting, and depression of all the senses. Under some circumstances of overexposure, death may occur. Isobutylene also has some degree of anesthetic action and can be mildly irritating to the mucous membranes. The effects associated with various levels of oxygen are as follows:

CONCENTRATION	SYMPTOMS OF EXPOSURE
12-16% Oxygen:	Breathing and pulse rate increased, muscular coordination slightly disturbed.
10-14% Oxygen:	Emotional upset, abnormal fatigue, disturbed respiration.
6-10% Oxygen:	Nausea and vomiting, collapse or loss of consciousness.
Below 6%:	Convulsive movements, possible respiratory collapse, and death.

OTHER POTENTIAL HEALTH EFFECTS: Contact with liquid or rapidly expanding gases (which are released under high pressure) may cause frostbite. Symptoms of frostbite include change in skin color to white or grayish-yellow. The pain after such contact can quickly subside.

HAZARDOUS MATERIAL INFORMATION SYSTEM

HEALTH	(BLUE)	1
FLAMMABILITY	(RED)	4
REACTIVITY	(YELLOW)	0
PROTECTIVE EQUIPMENT		B

EYES	RESPIRATORY	HANDS	BODY
	See Section 8		See Section 8

For routine industrial applications

See Section 16 for Definition of Ratings

HEALTH EFFECTS OR RISKS FROM EXPOSURE: An Explanation in **Lay Terms**. Overexposure to Isobutylene may cause the following health effects:

ACUTE: The most significant hazard associated with this gas is inhalation of oxygen-deficient atmospheres. Symptoms of oxygen deficiency include respiratory difficulty, headache, dizziness, and nausea. At high concentrations, unconsciousness or death may occur. Contact with liquefied gas or rapidly expanding gases may cause frostbite.

CHRONIC: There are currently no known adverse health effects associated with chronic exposure to Isobutylene.

TARGET ORGANS: Respiratory system.

PART II *What should I do if a hazardous situation occurs?*

4. FIRST-AID MEASURES

RESCUERS SHOULD NOT ATTEMPT TO RETRIEVE VICTIMS OF EXPOSURE TO ISOBUTYLENE WITHOUT ADEQUATE PERSONAL PROTECTIVE EQUIPMENT. At a minimum, Self-Contained Breathing Apparatus and Fire-Retardant Personal Protective equipment should be worn. Adequate fire protection must be provided during rescue situations.

4. FIRST-AID MEASURES (Continued)

Remove victim(s) to fresh air as quickly as possible. Trained personnel should administer supplemental oxygen and/or cardio-pulmonary resuscitation, if necessary. Only trained personnel should administer supplemental oxygen.

In case of frostbite, place the frostbitten part in warm water. DO NOT USE HOT WATER. If warm water is not available, or is impractical to use, wrap the affected parts gently in blankets. Alternatively, if the fingers or hands are frostbitten, place the affected area in the armpit. Encourage victim to gently exercise the affected part while being warmed. Seek immediate medical attention.

Victim(s) must be taken for medical attention. Rescuers should be taken for medical attention, if necessary. Take copy of label and MSDS to physician or other health professional with victim(s).

5. FIRE-FIGHTING MEASURES

FLASH POINT (Closed Cup): -10°C (< 14°F)
AUTOIGNITION TEMPERATURE: 465°C (869°F)
FLAMMABLE LIMITS (in air by volume, %):

Lower (LEL): 1.8%
Upper (UEL): 9.6%

NFPA RATING

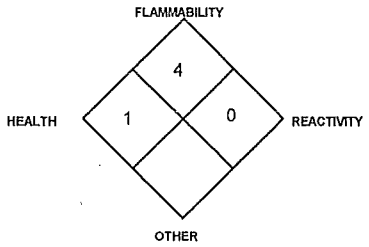

See Section 16 for Definition of Ratings

FIRE EXTINGUISHING MATERIALS: Extinguish Isobutylene fires by shutting off the source of the gas. Use water spray or a foam agent to cool fire-exposed containers, structures, and equipment.

UNUSUAL FIRE AND EXPLOSION HAZARDS: When involved in a fire, this material may ignite and produce toxic gases, including carbon monoxide and carbon dioxide.

DANGER! Fires impinging (direct flame) on the outside surface of unprotected pressure storage vessels of Isobutylene can be very dangerous. Direct flame exposure on the cylinder wall can cause an explosion either by BLEVE (Boiling Liquid Expanding Vapor Explosion), or by exothermic decomposition. This is a catastrophic failure of the vessel releasing the contents into a massive fireball and explosion. The resulting fire and explosion can result in severe equipment damage and personnel injury or death over a large area around the vessel. For massive fires in large areas, use unmanned hose holder or monitor nozzles; if this is not possible, withdraw from area and allow fire to burn.

Explosion Sensitivity to Mechanical Impact: Not sensitive.
Explosion Sensitivity to Static Discharge: Static discharge may cause Isobutylene to ignite explosively if released.

SPECIAL FIRE-FIGHTING PROCEDURES: Structural firefighters must wear Self-Contained Breathing Apparatus and full protective equipment. The best fire-fighting technique may be simply to let the burning gas escape from the pressurized cylinder, tank car, or pipeline. Stop the leak before extinguishing fire. If the fire is extinguished before the leak is sealed, the leaking gas could explosively re-ignite without warning and cause extensive damage, injury, or fatality. In this case, increase ventilation (in enclosed areas) to prevent flammable or explosive mixture formation. Structural firefighters must wear Self-Contained Breathing Apparatus and full protective equipment. Because of the potential for a BLEVE, evacuation of non-emergency personnel is essential. If water is not available for cooling or protection of vessel exposures, evacuate the area. Refer to the North American Emergency Response Guidebook for additional information. Other information for pre-planning can be found in the American Petroleum Institute Publications 2510 and 2510A.

6. ACCIDENTAL RELEASE MEASURES

SPILL AND LEAK RESPONSE: Uncontrolled releases should be responded to by trained personnel using pre-planned procedures. Proper protective equipment should be used. In case of a release, clear the affected area, protect people, and respond with trained personnel. Adequate fire protection must be provided. Minimum Personal Protective Equipment should be **Level B: fire-retardant protective clothing, gloves resistant to tears, and Self-Contained Breathing Apparatus.**

Use only non-sparking tools and equipment. Locate and seal the source of the leaking gas. Protect personnel attempting the shut off with water spray. Allow the gas to dissipate. Monitor the surrounding area for combustible gas levels and oxygen. Combustible gas concentration must be below 10% of the LEL (LEL = 1.8%) prior to entry. The atmosphere must have at least 19.5 percent oxygen before personnel can be allowed in the area without Self-Contained Breathing Apparatus. Attempt to close the main source valve prior to entering the area. If this does not stop the release (or if it is not possible to reach the valve), allow the gas to release in place or remove it to a safe area and allow the gas to be released there.

THIS IS AN EXTREMELY FLAMMABLE GAS. Protection of all personnel and the area must be maintained.

PART III *How can I prevent hazardous situations from occurring?*

7. HANDLING and STORAGE

WORK PRACTICES AND HYGIENE PRACTICES: As with all chemicals, avoid getting Isobutylene IN YOU. Do not eat or drink while handling chemicals. Be aware of any signs of dizziness or fatigue; exposures to fatal concentrations of Isobutylene could occur without any significant warning symptoms.

STORAGE AND HANDLING PRACTICES: Cylinders should be stored in dry, well-ventilated areas away from sources of heat. Compressed gases can present significant safety hazards. Store containers away from heavily trafficked areas and emergency exits. Post "No Smoking or Open Flames" signs in storage or use areas.

SPECIAL PRECAUTIONS FOR HANDLING GAS CYLINDERS: Protect cylinders against physical damage. Store in cool, dry, well-ventilated area, away from sources of heat, ignition and direct sunlight. Do not allow area where cylinders are stored to exceed 52°C (125°F). Isolate from oxidizers such as oxygen, chlorine, or fluorine. Use a check valve or trap in the discharge line to prevent hazardous backflow. Post "No Smoking or Open Flame" signs in storage and use areas. Cylinders should be stored upright and be firmly secured to prevent falling or being knocked over. Cylinders can be stored in the open, but in such cases, should be protected against extremes of weather and from the dampness of the ground to prevent rusting. Never tamper with pressure relief devices in valves and cylinders. Electrical equipment should be non-sparking or explosion proof. The following rules are applicable to situations in which cylinders are being used:

Before Use: Move cylinders with a suitable hand truck. Do not drag, slide, or roll cylinders. Do not drop cylinders or permit them to strike each other. Secure cylinders firmly. Leave the valve protection cap, if provided, in place until cylinder is ready for use.

During Use: Use designated CGA fittings and other support equipment. Do not use adapters. Do not heat cylinder by any means to increase the discharge rate of the product from the cylinder. Use check valve or trap in discharge line to prevent hazardous backflow into the cylinder. Do not use oils or grease on gas-handling fittings or equipment.

After Use: Close main cylinder valve. Replace valve protection cap, if provided. Mark empty cylinders "EMPTY".

NOTE: Use only DOT or ASME code containers. Earth-ground and bond all lines and equipment associated with Isobutylene. Close valve after each use and when empty. Cylinders must not be recharged except by or with the consent of owner. For additional information refer to the Compressed Gas Association Pamphlet P-1, *Safe Handling of Compressed Gases in Containers*. Additionally, refer to CGA Bulletin SB-2 "*Oxygen Deficient Atmospheres*".

PROTECTIVE PRACTICES DURING MAINTENANCE OF CONTAMINATED EQUIPMENT: Follow practices indicated in Section 6 (Accidental Release Measures). Make certain that application equipment is locked and tagged-out safely. Purge gas handling equipment with inert gas (e.g., nitrogen) before attempting repairs.

8. EXPOSURE CONTROLS - PERSONAL PROTECTION

VENTILATION AND ENGINEERING CONTROLS: Use with adequate ventilation. Local exhaust ventilation is preferred, because it prevents Isobutylene dispersion into the work place by eliminating it at its source. If appropriate, install automatic monitoring equipment to detect the presence of potentially explosive air-gas mixtures and level of oxygen.

RESPIRATORY PROTECTION: Maintain oxygen levels above 19.5% in the workplace. Maintain level of gas below the level listed in Section 2 (Composition and Information on Ingredients). Use supplied air respiratory protection if oxygen levels are below 19.5% or during emergency response to a release of Isobutylene. If respiratory protection is required, follow the requirements of the Federal OSHA Respiratory Protection Standard (29 CFR 1910.134) or equivalent State standards.

EYE PROTECTION: Splash goggles or safety glasses, for protection from rapidly expanding gases and splashes of liquid Isobutylene.

HAND PROTECTION: Wear gloves resistant to tears when handling cylinders of Isobutylene. Use low-temperature protective gloves (e.g., Kevlar) when working with containers of liquid Isobutylene.

BODY PROTECTION: Use body protection appropriate for task. Transfer of large quantities under pressure may require protective equipment appropriate to protect employees from splashes of liquefied product, as well as fire retardant items.

9. PHYSICAL and CHEMICAL PROPERTIES

VAPOR DENSITY @ 21.1°C (70°F): 2.396 kg/m^3 (0.1496 lb/ft^3)
SPECIFIC GRAVITY (air = 1): 1.997
SOLUBILITY IN WATER: Insoluble.
EVAPORATION RATE (nBuAc = 1): Not applicable.
ODOR THRESHOLD: Not established.
COEFFICIENT WATER/OIL DISTRIBUTION: Not applicable.
pH: Not applicable.
FREEZING POINT: -140°C (-220.6°F)
BOILING POINT @ 1 atm: -6.9°C (19.6°F)
EXPANSION RATIO: Not applicable
VAPOR PRESSURE (psia): 39
SPECIFIC VOLUME (ft^3/lb): 6.7

APPEARANCE AND COLOR: Colorless gas with the unpleasant odor of burning coal. The liquid is also colorless and has the same unpleasant odor of burning coal.

HOW TO DETECT THIS SUBSTANCE (warning properties): There are no distinct warning properties. In terms of leak detection, fittings and joints can be painted with a soap solution to detect leaks, which will be indicated by a bubble formation.

10. STABILITY and REACTIVITY

STABILITY: Stable.

DECOMPOSITION PRODUCTS: When ignited in the presence of oxygen, this gas will burn to produce carbon monoxide and carbon dioxide.

MATERIALS WITH WHICH SUBSTANCE IS INCOMPATIBLE: Strong oxidizers (e.g., chlorine, bromine pentafluoride, oxygen, oxygen difluoride, and nitrogen trifluoride).

HAZARDOUS POLYMERIZATION: Will not occur.

CONDITIONS TO AVOID: Contact with incompatible materials and exposure to heat, sparks, and other sources of ignition. Cylinders exposed to high temperatures or direct flame can rupture or burst.

PART IV *Is there any other useful information about this material?*

11. TOXICOLOGICAL INFORMATION

TOXICITY DATA: The following information is for pure Isobutylene.

ISOBUTYLENE:
LC_{50} (rat, inhalation) = 620 g/m^3/4 hours
LC_{50} (mouse, inhalation) = 415 g/m^3/2 hours

SUSPECTED CANCER AGENT: Isobutylene is not found on the following lists: FEDERAL OSHA Z LIST, NTP, IARC, CAL/OSHA, and therefore is neither considered to be nor suspected to be a cancer-causing agent by these agencies.

IRRITANCY OF PRODUCT: Isobutylene may be mildly irritating to the mucous membranes. In addition, contact with rapidly expanding gases can cause frostbite to exposed tissue.

SENSITIZATION TO THE PRODUCT: Isobutylene is not known to cause sensitization in humans.

REPRODUCTIVE TOXICITY INFORMATION: Listed below is information concerning the effects of Isobutylene on the human reproductive system.

Mutagenicity: No mutagenic effects have been described for Isobutylene.
Embryotoxicity: No embryotoxic effects have been described for Isobutylene.
Teratogenicity: No teratogenic effects have been described for Isobutylene.
Reproductive Toxicity: No reproductive toxicity effects have been described for Isobutylene.

A mutagen is a chemical which causes permanent changes to genetic material (DNA) such that the changes will propagate through generational lines. An embryotoxin is a chemical which causes damage to a developing embryo (i.e., within the first eight weeks of pregnancy in humans), but the damage does not propagate across generational lines. A teratogen is a chemical which causes damage to a developing fetus, but the damage does not propagate across generational lines. A reproductive toxin is any substance which interferes in any way with the reproductive process.

MEDICAL CONDITIONS AGGRAVATED BY EXPOSURE: Acute or chronic respiratory conditions may be aggravated by overexposure to Isobutylene.

11. TOXICOLOGICAL INFORMATION (Continued)

RECOMMENDATIONS TO PHYSICIANS: Administer oxygen, if necessary. Treat symptoms and eliminate exposure.

BIOLOGICAL EXPOSURE INDICES (BEIs): Currently, Biological Exposure Indices (BEIs) are not applicable for Isobutylene.

12. ECOLOGICAL INFORMATION

ENVIRONMENTAL STABILITY: This gas will be dissipated rapidly in well-ventilated areas.

EFFECT OF MATERIAL ON PLANTS or ANIMALS: Any adverse effect on animals would be related to oxygen-deficient environments. No adverse effect is anticipated to occur to plant life, except for frost produced in the presence of rapidly expanding gases. See Section 11, Toxicological Information, for additional information on effects on animals.

EFFECT OF CHEMICAL ON AQUATIC LIFE: No evidence is currently available on the effects of Isobutylene on aquatic life.

13. DISPOSAL CONSIDERATIONS

PREPARING WASTES FOR DISPOSAL: Waste disposal must be in accordance with appropriate Federal, State, and local regulations. Return cylinders with any residual product to MESA Specialty Gases & Equipment Do not dispose of locally.

14. TRANSPORTATION INFORMATION

THIS MATERIAL IS HAZARDOUS AS DEFINED BY 49 CFR 172.101 BY THE U.S. DEPARTMENT OF TRANSPORTATION.

For Isobutylene Gas:

PROPER SHIPPING NAME:	Isobutylene
HAZARD CLASS NUMBER and DESCRIPTION:	2.1 (Flammable Gas)
UN IDENTIFICATION NUMBER:	UN 1055
PACKING GROUP:	Not Applicable
DOT LABEL(S) REQUIRED:	Flammable Gas

NORTH AMERICAN EMERGENCY RESPONSE GUIDEBOOK NUMBER (1996): 115

Alternate Description:

PROPER SHIPPING NAME:	Petroleum gases, liquefied
HAZARD CLASS NUMBER and DESCRIPTION:	2.1 (Flammable Gas)
UN IDENTIFICATION NUMBER:	UN 1075
PACKING GROUP:	Not Applicable
DOT LABEL(S) REQUIRED:	Flammable Gas

NORTH AMERICAN EMERGENCY RESPONSE GUIDEBOOK NUMBER (1996): 115

MARINE POLLUTANT: Isobutylene is not classified by the DOT as a Marine Pollutant (as defined by 49 CFR 172.101, Appendix B).

TRANSPORT CANADA TRANSPORTATION OF DANGEROUS GOODS REGULATIONS: THIS MATERIAL IS CONSIDERED AS DANGEROUS GOODS. Use the above information for the preparation of Canadian Shipments.

15. REGULATORY INFORMATION

U.S. SARA REPORTING REQUIREMENTS: Isobutylene is not subject to the reporting requirements of Sections 302, 304, and 313 of Title III of the Superfund Amendments and Reauthorization Act.

U.S. SARA THRESHOLD PLANNING QUANTITY: Not applicable.

U.S. CERCLA REPORTABLE QUANTITY (RQ): Not applicable.

CANADIAN DSL/NDSL INVENTORY STATUS: Isobutylene is on the DSL Inventory.

U.S. TSCA INVENTORY STATUS: Isobutylene is listed on the TSCA Inventory.

15. REGULATORY INFORMATION (Continued)

OTHER U.S. FEDERAL REGULATIONS: Isobutylene is subject to the reporting requirements of Section 112(r) of the Clean Air Act. The Threshold Quantity for this gas is 10,000 lb. Depending on specific operations involving the use of Isobutylene, the regulations of the Process Safety Management of Highly Hazardous Chemicals may be applicable (29 CFR 1910.119). Under this regulation Isobutylene is not listed in Appendix A; however, any process that involves a flammable gas on-site, in one location, in quantities of 10,000 lb (4,553 kg) or greater is covered under this regulation unless it is used as a fuel.

U.S. STATE REGULATORY INFORMATION: Isobutylene is covered under specific State regulations, as denoted below:

Alaska - Designated Toxic and Hazardous Substances: Liquefied Petroleum Gas.
California - Permissible Exposure Limits for Chemical Contaminants: Liquefied Petroleum Gas.
Florida - Substance List: Isobutylene.
Illinois - Toxic Substance List: No.
Kansas - Section 302/313 List: No.
Massachusetts - Substance List: Isobutylene.
Michigan - Critical Materials Register: No.
Minnesota - List of Hazardous Substances: Liquefied Petroleum Gas.
Missouri - Employer Information/Toxic Substance List: No.
New Jersey - Right to Know Hazardous Substance List: Isobutylene.
North Dakota - List of Hazardous Chemicals, Reportable Quantities: No.
Pennsylvania - Hazardous Substance List: Isobutylene.
Rhode Island - Hazardous Substance List: Liquefied Petroleum Gas.
Texas - Hazardous Substance List: Liquefied Petroleum Gas.
West Virginia - Hazardous Substance List: Liquefied Petroleum Gas.
Wisconsin - Toxic and Hazardous Substances: Liquefied Petroleum Gas.

CALIFORNIA SAFE DRINKING WATER AND TOXIC ENFORCEMENT ACT (PROPOSITION 65): Isobutylene is not on the California Proposition 65 lists.

LABELING:

DANGER:

FLAMMABLE LIQUID AND GAS UNDER PRESSURE.
CAN FORM EXPLOSIVE MIXTURES WITH AIR.
MAY CAUSE FROSTBITE.

Keep away from heat, flames, and sparks.
Store and use with adequate ventilation.
Cylinder temperature should not exceed 52°C (125°F).
Do not get liquid in eyes, on skin, or clothing.
Close valve after each use and when empty.
Use in accordance with the Material Safety Data Sheet.

FIRST AID:

IF INHALED, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Call a physician.

IN CASE OF FROSTBITE, obtain immediate medical attention.

DO NOT REMOVE THIS PRODUCT LABEL.

CANADIAN WHMIS SYMBOLS:

Class A: Compressed Gas
Class B1: Flammable Gas

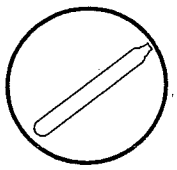

16. OTHER INFORMATION

The information contained herein is based on data considered accurate. However, no warranty is expressed or implied regarding the accuracy of these data or the results to be obtained from the use thereof. MESA Specialty Gases & Equipment assumes no responsibility for injury to the vendee or third persons proximately caused by the material if reasonable safety procedures are not adhered to as stipulated in the data sheet. Additionally, MESA Specialty Gases & Equipment assumes no responsibility for injury to vendee or third persons proximately caused by abnormal use of the material even if reasonable safety procedures are followed. Furthermore, vendee assumes the risk in his use of the material.

DEFINITIONS OF TERMS

A large number of abbreviations and acronyms appear on a MSDS. Some of these which are commonly used include the following:

CAS #: This is the Chemical Abstract Service Number which uniquely identifies each constituent. It is used for computer-related searching.

EXPOSURE LIMITS IN AIR:
ACGIH - American Conference of Governmental Industrial Hygienists, a professional association which establishes exposure limits. **TLV** - Threshold Limit Value - an airborne concentration of a substance which represents conditions under which it is generally believed that nearly all workers may be repeatedly exposed without adverse effect. The duration must be considered, including the 8-hour Time Weighted Average **(TWA)**, the 15-minute Short Term Exposure Limit, and the instantaneous Ceiling Level **(C)**. Skin absorption effects must also be considered.
OSHA - U.S. Occupational Safety and Health Administration. **PEL** - Permissible Exposure Limit - This exposure value means exactly the same as a TLV, except that it is enforceable by OSHA. The OSHA Permissible Exposure Limits are based in the 1989 PELs and the June, 1993 Air Contaminants Rule (Federal Register: 58: 35338-35351 and 58: 40191). Both the current PELs and the vacated PELs are indicated. The phrase, "Vacated 1989 PEL," is placed next to the PEL which was vacated by Court Order.
IDLH - Immediately Dangerous to Life and Health - This level represents a concentration from which one can escape within 30-minutes without suffering escape-preventing or permanent injury. **The DFG - MAK** is the Republic of Germany's Maximum Exposure Level, similar to the U.S. PEL. **NIOSH** is the National Institute of Occupational Safety and Health, which is the research arm of the U.S. Occupational Safety and Health Administration **(OSHA)**. NIOSH issues exposure guidelines called Recommended Exposure Levels **(RELs)**. When no exposure guidelines are established, an entry of **NE** is made for reference.

HAZARD RATINGS:
HAZARDOUS MATERIALS IDENTIFICATION SYSTEM: Health Hazard: **0** (minimal acute or chronic exposure hazard); **1** (slight acute or chronic exposure hazard); **2** (moderate acute or significant chronic exposure hazard); **3** (severe acute exposure hazard; onetime overexposure can result in permanent injury and may be fatal); **4** (extreme acute exposure hazard; onetime overexposure can be fatal). Flammability Hazard: **0** (minimal hazard); **1** (materials that require substantial pre-heating before burning); **2** (combustible liquid or solids; liquids with a flash point of 38-93°C [100-200°F]); **3** (Class IB and IC flammable liquids with flash points below 38°C [100°F]); **4** (Class IA flammable liquids with flash points below 23°C [73°F] and boiling points below 38°C [100°F]. Reactivity Hazard: **0** (normally stable); **1** (material that can become unstable at elevated temperatures or which can react slightly with water); **2** (materials that are unstable but do not detonate or which can react violently with water); **3** (materials that can detonate when initiated or which can react explosively with water); **4** (materials that can detonate at normal temperatures or pressures).
NATIONAL FIRE PROTECTION ASSOCIATION: Health Hazard: **0** (material that on exposure under fire conditions would offer no hazard beyond that of ordinary combustible materials); **1** (materials that on exposure under fire conditions could cause irritation or minor residual injury); **2** (materials that on intense or continued exposure under fire conditions could cause temporary incapacitation or possible residual injury); **3** (materials that can on short exposure could cause serious temporary or residual injury); **4** (materials that under very short exposure causes death or major residual injury).

NATIONAL FIRE PROTECTION ASSOCIATION (Continued): Flammability Hazard and Reactivity Hazard: Refer to definitions for "Hazardous Materials Identification System".

FLAMMABILITY LIMITS IN AIR:
Much of the information related to fire and explosion is derived from the National Fire Protection Association **(NFPA)**. Flash Point - Minimum temperature at which a liquid gives off sufficient vapors to form an ignitable mixture with air. Autoignition Temperature: The minimum temperature required to initiate combustion in air with no other source of ignition. LEL - the lowest percent of vapor in air, by volume, that will explode or ignite in the presence of an ignition source. UEL - the highest percent of vapor in air, by volume, that will explode or ignite in the presence of an ignition source.

TOXICOLOGICAL INFORMATION:
Possible health hazards as derived from human data, animal studies, or from the results of studies with similar compounds are presented. Definitions of some terms used in this section are: **LD_{50}** - Lethal Dose (solids & liquids) which kills 50% of the exposed animals; **LC_{50}** - Lethal Concentration (gases) which kills 50% of the exposed animals; **ppm** concentration expressed in parts of material per million parts of air or water; **mg/m^3** concentration expressed in weight of substance per volume of air; **mg/kg** quantity of material, by weight, administered to a test subject, based on their body weight in kg. Data from several sources are used to evaluate the cancer-causing potential of the material. The sources are: **IARC** - the International Agency for Research on Cancer; **NTP** - the National Toxicology Program, **RTECS** - the Registry of Toxic Effects of Chemical Substances, **OSHA** and **CAL/OSHA**. IARC and NTP rate chemicals on a scale of decreasing potential to cause human cancer with rankings from 1 to 4. Subrankings (2A, 2B, etc.) are also used. Other measures of toxicity include **TDLo**, the lowest dose to cause a symptom and **TCLo** the lowest concentration to cause a symptom; **TDo, LDLo**, and **LDo**, or **TC, TCo, LCLo**, and **LCo**, the lowest dose (or concentration) to cause lethal or toxic effects. **BEI** - Biological Exposure Indices, represent the levels of determinants which are most likely to be observed in specimens collected from a healthy worker who has been exposed to chemicals to the same extent as a worker with inhalation exposure to the TLV. Ecological Information: EC is the effect concentration in water.

REGULATORY INFORMATION:
This section explains the impact of various laws and regulations on the material. **EPA** is the U.S. Environmental Protection Agency. **WHMIS** is the Canadian Workplace Hazardous Materials Information System. **DOT** and **TC** are the U.S. Department of Transportation and the Transport Canada, respectively. Superfund Amendments and Reauthorization Act **(SARA)**; the Canadian Domestic/Non-Domestic Substances List **(DSL/NDSL)**; the U.S. Toxic Substance Control Act **(TSCA)**; Marine Pollutant status according to the **DOT**; the Comprehensive Environmental Response, Compensation, and Liability Act **(CERCLA or Superfund)**; and various state regulations.

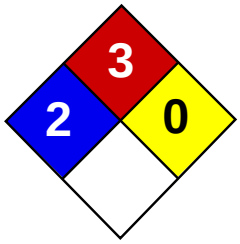

Material Safety Data Sheet
Benzene MSDS

Section 1: Chemical Product and Company Identification

Product Name: Benzene

Catalog Codes: SLB1564, SLB3055, SLB2881

CAS#: 71-43-2

RTECS: CY1400000

TSCA: TSCA 8(b) inventory: Benzene

CI#: Not available.

Synonym: Benzol; Benzine

Chemical Name: Benzene

Chemical Formula: C6-H6

Contact Information:

Sciencelab.com, Inc.
14025 Smith Rd.
Houston, Texas 77396

US Sales: **1-800-901-7247**
International Sales: **1-281-441-4400**

Order Online: ScienceLab.com

CHEMTREC (24HR Emergency Telephone), call:
1-800-424-9300

International CHEMTREC, call: 1-703-527-3887

For non-emergency assistance, call: 1-281-441-4400

Section 2: Composition and Information on Ingredients

Composition:

Name	CAS #	% by Weight
Benzene	71-43-2	100

Toxicological Data on Ingredients: Benzene: ORAL (LD50): Acute: 930 mg/kg [Rat]. 4700 mg/kg [Mouse]. DERMAL (LD50): Acute: >9400 mg/kg [Rabbit]. VAPOR (LC50): Acute: 10000 ppm 7 hours [Rat].

Section 3: Hazards Identification

Potential Acute Health Effects:
Very hazardous in case of eye contact (irritant), of inhalation. Hazardous in case of skin contact (irritant, permeator), of ingestion. Inflammation of the eye is characterized by redness, watering, and itching.

Potential Chronic Health Effects:
CARCINOGENIC EFFECTS: Classified A1 (Confirmed for human.) by ACGIH, 1 (Proven for human.) by IARC. MUTAGENIC EFFECTS: Classified POSSIBLE for human. Mutagenic for mammalian somatic cells. Mutagenic for bacteria and/or yeast. TERATOGENIC EFFECTS: Not available. DEVELOPMENTAL TOXICITY: Classified Reproductive system/toxin/female [POSSIBLE]. The substance is toxic to blood, bone marrow, central nervous system (CNS). The substance may be toxic to liver, Urinary System. Repeated or prolonged exposure to the substance can produce target organs damage.

Section 4: First Aid Measures

Eye Contact:
Check for and remove any contact lenses. In case of contact, immediately flush eyes with plenty of water for at least 15 minutes. Cold water may be used. WARM water MUST be used. Get medical attention immediately.

Skin Contact:
In case of contact, immediately flush skin with plenty of water. Cover the irritated skin with an emollient. Remove contaminated clothing and shoes. Wash clothing before reuse. Thoroughly clean shoes before reuse. Get medical attention.

Serious Skin Contact:
Wash with a disinfectant soap and cover the contaminated skin with an anti-bacterial cream. Seek immediate medical attention.

Inhalation:
If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention if symptoms appear.

Serious Inhalation:
Evacuate the victim to a safe area as soon as possible. Loosen tight clothing such as a collar, tie, belt or waistband. If breathing is difficult, administer oxygen. If the victim is not breathing, perform mouth-to-mouth resuscitation. Seek medical attention.

Ingestion:
Do NOT induce vomiting unless directed to do so by medical personnel. Never give anything by mouth to an unconscious person. If large quantities of this material are swallowed, call a physician immediately. Loosen tight clothing such as a collar, tie, belt or waistband.

Serious Ingestion: Not available.

Section 5: Fire and Explosion Data

Flammability of the Product: Flammable.

Auto-Ignition Temperature: 497.78°C (928°F)

Flash Points: CLOSED CUP: -11.1°C (12°F). (Setaflash)

Flammable Limits: LOWER: 1.2% UPPER: 7.8%

Products of Combustion: These products are carbon oxides (CO, CO2).

Fire Hazards in Presence of Various Substances:
Highly flammable in presence of open flames and sparks, of heat. Slightly flammable to flammable in presence of oxidizing materials. Non-flammable in presence of shocks.

Explosion Hazards in Presence of Various Substances:
Risks of explosion of the product in presence of mechanical impact: Not available. Risks of explosion of the product in presence of static discharge: Not available. Explosive in presence of oxidizing materials, of acids.

Fire Fighting Media and Instructions:
Flammable liquid, soluble or dispersed in water. SMALL FIRE: Use DRY chemical powder. LARGE FIRE: Use alcohol foam, water spray or fog.

Special Remarks on Fire Hazards:
Extremely flammable liquid and vapor. Vapor may cause flash fire. Reacts on contact with iodine heptafluoride gas. Dioxygenyl tetrafluoroborate is as very powferful oxidant. The addition of a small particle to small samples of benzene, at ambient temperature, causes ignition. Contact with sodium peroxide with benzene causes ignition. Benzene ignites in contact with powdered chromic anhydride. Virgorous or incandescent reaction with hydrogen + Raney nickel (above 210 C) and bromine trifluoride.

Special Remarks on Explosion Hazards:
Benzene vapors + chlorine and light causes explosion. Reacts explosively with bromine pentafluoride, chlorine, chlorine trifluoride, diborane, nitric acid, nitryl perchlorate, liquid oxygen, ozone, silver perchlorate. Benzene + pentafluoride and methoxide (from arsenic pentafluoride and potassium methoxide) in trichlorotrifluoroethane causes explosion. Interaction

of nitryl perchlorate with benzene gave a slight explosion and flash. The solution of permanganic acid (or its explosive anhydride, dimaganese heptoxide) produced by interaction of permanganates and sulfuric acid will explode on contact with benzene. Peroxodisulfuric acid is a very powferful oxidant. Uncontrolled contact with benzene may cause explosion. Mixtures of peroxomonsulfuric acid with benzene explodes.

Section 6: Accidental Release Measures

Small Spill: Absorb with an inert material and put the spilled material in an appropriate waste disposal.

Large Spill:
Flammable liquid. Keep away from heat. Keep away from sources of ignition. Stop leak if without risk. Absorb with DRY earth, sand or other non-combustible material. Do not touch spilled material. Prevent entry into sewers, basements or confined areas; dike if needed. Be careful that the product is not present at a concentration level above TLV. Check TLV on the MSDS and with local authorities.

Section 7: Handling and Storage

Precautions:
Keep locked up.. Keep away from heat. Keep away from sources of ignition. Ground all equipment containing material. Do not ingest. Do not breathe gas/fumes/ vapor/spray. In case of insufficient ventilation, wear suitable respiratory equipment. If ingested, seek medical advice immediately and show the container or the label. Avoid contact with skin and eyes. Keep away from incompatibles such as oxidizing agents, acids.

Storage:
Store in a segregated and approved area. Keep container in a cool, well-ventilated area. Keep container tightly closed and sealed until ready for use. Avoid all possible sources of ignition (spark or flame).

Section 8: Exposure Controls/Personal Protection

Engineering Controls:
Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapors below their respective threshold limit value. Ensure that eyewash stations and safety showers are proximal to the work-station location.

Personal Protection:
Splash goggles. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Gloves.

Personal Protection in Case of a Large Spill:
Splash goggles. Full suit. Vapor respirator. Boots. Gloves. A self contained breathing apparatus should be used to avoid inhalation of the product. Suggested protective clothing might not be sufficient; consult a specialist BEFORE handling this product.

Exposure Limits:
TWA: 0.5 STEL: 2.5 (ppm) from ACGIH (TLV) [United States] TWA: 1.6 STEL: 8 (mg/m3) from ACGIH (TLV) [United States] TWA: 0.1 STEL: 1 from NIOSH TWA: 1 STEL: 5 (ppm) from OSHA (PEL) [United States] TWA: 10 (ppm) from OSHA (PEL) [United States] TWA: 3 (ppm) [United Kingdom (UK)] TWA: 1.6 (mg/m3) [United Kingdom (UK)] TWA: 1 (ppm) [Canada] TWA: 3.2 (mg/m3) [Canada] TWA: 0.5 (ppm) [Canada]Consult local authorities for acceptable exposure limits.

Section 9: Physical and Chemical Properties

Physical state and appearance: Liquid.

Odor:
Aromatic. Gasoline-like, rather pleasant. (Strong.)

Taste: Not available.

Molecular Weight: 78.11 g/mole

Color: Clear Colorless. Colorless to light yellow.

pH (1% soln/water): Not available.

Boiling Point: 80.1 (176.2°F)

Melting Point: 5.5°C (41.9°F)

Critical Temperature: 288.9°C (552°F)

Specific Gravity: 0.8787 @ 15 C (Water = 1)

Vapor Pressure: 10 kPa (@ 20°C)

Vapor Density: 2.8 (Air = 1)

Volatility: Not available.

Odor Threshold: 4.68 ppm

Water/Oil Dist. Coeff.: The product is more soluble in oil; log(oil/water) = 2.1

Ionicity (in Water): Not available.

Dispersion Properties: See solubility in water, diethyl ether, acetone.

Solubility:
Miscible in alcohol, chloroform, carbon disulfide oils, carbon tetrachloride, glacial acetic acid, diethyl ether, acetone. Very slightly soluble in cold water.

Section 10: Stability and Reactivity Data

Stability: The product is stable.

Instability Temperature: Not available.

Conditions of Instability: Heat, ignition sources, incompatibles.

Incompatibility with various substances: Highly reactive with oxidizing agents, acids.

Corrosivity: Non-corrosive in presence of glass.

Special Remarks on Reactivity:
Benzene vapors + chlorine and light causes explosion. Reacts explosively with bromine pentafluoride, chlorine, chlorine trifluoride, diborane, nitric acid, nitryl perchlorate, liquid oxygen, ozone, silver perchlorate. Benzene + pentafluoride and methoxide (from arsenic pentafluoride and potassium methoxide) in trichlorotrifluoroethane causes explosion. Interaction of nitryl perchlorate with benzene gave a slight explosion and flash. The solution of permanganic acid (or its explosive anhydride, dimaganese heptoxide) produced by interaction of permanganates and sulfuric acid will explode on contact with benzene. Peroxodisulfuric acid is a very powferful oxidant. Uncontrolled contact with benzene may cause explosion. Mixtures of peroxomonsulfuric acid with benzene explodes.

Special Remarks on Corrosivity: Not available.

Polymerization: Will not occur.

Section 11: Toxicological Information

Routes of Entry: Absorbed through skin. Dermal contact. Eye contact. Inhalation.

Toxicity to Animals:
WARNING: THE LC50 VALUES HEREUNDER ARE ESTIMATED ON THE BASIS OF A 4-HOUR EXPOSURE. Acute oral toxicity (LD50): 930 mg/kg [Rat]. Acute dermal toxicity (LD50): >9400 mg/kg [Rabbit]. Acute toxicity of the vapor (LC50): 10000 7 hours [Rat].

Chronic Effects on Humans:

CARCINOGENIC EFFECTS: Classified A1 (Confirmed for human.) by ACGIH, 1 (Proven for human.) by IARC. MUTAGENIC EFFECTS: Classified POSSIBLE for human. Mutagenic for mammalian somatic cells. Mutagenic for bacteria and/or yeast. DEVELOPMENTAL TOXICITY: Classified Reproductive system/toxin/female [POSSIBLE]. Causes damage to the following organs: blood, bone marrow, central nervous system (CNS). May cause damage to the following organs: liver, Urinary System.

Other Toxic Effects on Humans:
Very hazardous in case of inhalation. Hazardous in case of skin contact (irritant, permeator), of ingestion.

Special Remarks on Toxicity to Animals: Not available.

Special Remarks on Chronic Effects on Humans:
May cause adverse reproductive effects (female fertility, Embryotoxic and/or foetotoxic in animal) and birth defects. May affect genetic material (mutagenic). May cause cancer (tumorigenic, leukemia)) Human: passes the placental barrier, detected in maternal milk.

Special Remarks on other Toxic Effects on Humans:
Acute Potential Health Effects: Skin: Causes skin irritation. It can be absorbed through intact skin and affect the liver, blood, metabolism,and urinary system. Eyes: Causes eye irritation. Inhalation: Causes respiratory tract and mucous membrane irritation. Can be absorbed through the lungs. May affect behavior/Central and Peripheral nervous systems (somnolence, muscle weakness, general anesthetic, and other symptoms similar to ingestion), gastrointestinal tract (nausea), blood metabolism, urinary system. Ingestion: May be harmful if swallowed. May cause gastrointestinal tract irritation including vomiting. May affect behavior/Central and Peripheral nervous systems (convulsions, seizures, tremor, irritability, initial CNS stimulation followed by depression, loss of coordination, dizziness, headache, weakness, pallor, flushing), respiration (breathlessness and chest constriction), cardiovascular system, (shallow/rapid pulse), and blood.

Section 12: Ecological Information

Ecotoxicity: Not available.

BOD5 and COD: Not available.

Products of Biodegradation:
Possibly hazardous short term degradation products are not likely. However, long term degradation products may arise.

Toxicity of the Products of Biodegradation: The products of degradation are less toxic than the product itself.

Special Remarks on the Products of Biodegradation: Not available.

Section 13: Disposal Considerations

Waste Disposal:
Waste must be disposed of in accordance with federal, state and local environmental control regulations.

Section 14: Transport Information

DOT Classification: CLASS 3: Flammable liquid.

Identification: : Benzene UNNA: 1114 PG: II

Special Provisions for Transport: Not available.

Section 15: Other Regulatory Information

Federal and State Regulations:
California prop. 65: This product contains the following ingredients for which the State of California has found to cause cancer, birth defects or other reproductive harm, which would require a warning under the statute: Benzene California prop. 65 (no significant risk level): Benzene: 0.007 mg/day (value) California prop. 65: This product contains the following ingredients

for which the State of California has found to cause cancer which would require a warning under the statute: Benzene Connecticut carcinogen reporting list.: Benzene Connecticut hazardous material survey.: Benzene Illinois toxic substances disclosure to employee act: Benzene Illinois chemical safety act: Benzene New York release reporting list: Benzene Rhode Island RTK hazardous substances: Benzene Pennsylvania RTK: Benzene Minnesota: Benzene Michigan critical material: Benzene Massachusetts RTK: Benzene Massachusetts spill list: Benzene New Jersey: Benzene New Jersey spill list: Benzene Louisiana spill reporting: Benzene California Director's list of Hazardous Substances: Benzene TSCA 8(b) inventory: Benzene SARA 313 toxic chemical notification and release reporting: Benzene CERCLA: Hazardous substances.: Benzene: 10 lbs. (4.536 kg)

Other Regulations:
OSHA: Hazardous by definition of Hazard Communication Standard (29 CFR 1910.1200). EINECS: This product is on the European Inventory of Existing Commercial Chemical Substances.

Other Classifications:

WHMIS (Canada):
CLASS B-2: Flammable liquid with a flash point lower than 37.8°C (100°F). CLASS D-2A: Material causing other toxic effects (VERY TOXIC).

DSCL (EEC):
R11- Highly flammable. R22- Harmful if swallowed. R38- Irritating to skin. R41- Risk of serious damage to eyes. R45- May cause cancer. R62- Possible risk of impaired fertility. S2- Keep out of the reach of children. S26- In case of contact with eyes, rinse immediately with plenty of water and seek medical advice. S39- Wear eye/face protection. S46- If swallowed, seek medical advice immediately and show this container or label. S53- Avoid exposure - obtain special instructions before use.

HMIS (U.S.A.):

Health Hazard: 2

Fire Hazard: 3

Reactivity: 0

Personal Protection: h

National Fire Protection Association (U.S.A.):

Health: 2

Flammability: 3

Reactivity: 0

Specific hazard:

Protective Equipment:
Gloves. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate. Splash goggles.

Section 16: Other Information

References: Not available.

Other Special Considerations: Not available.

Created: 10/10/2005 08:35 PM

Last Updated: 11/06/2008 12:00 PM

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no event shall ScienceLab.com be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if ScienceLab.com has been advised of the possibility of such damages.

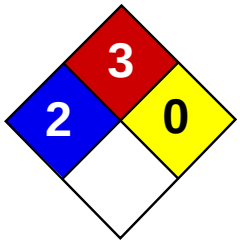

Health	2
Fire	3
Reactivity	0
Personal Protection	H

Material Safety Data Sheet
Toluene MSDS

Section 1: Chemical Product and Company Identification

Product Name: Toluene

Catalog Codes: SLT2857, SLT3277

CAS#: 108-88-3

RTECS: XS5250000

TSCA: TSCA 8(b) inventory: Toluene

CI#: Not available.

Synonym: Toluol, Tolu-Sol; Methylbenzene; Methacide; Phenylmethane; Methylbenzol

Chemical Name: Toluene

Chemical Formula: C6-H5-CH3 or C7-H8

Contact Information:

Sciencelab.com, Inc.
14025 Smith Rd.
Houston, Texas 77396

US Sales: **1-800-901-7247**
International Sales: **1-281-441-4400**

Order Online: ScienceLab.com

CHEMTREC (24HR Emergency Telephone), call: 1-800-424-9300

International CHEMTREC, call: 1-703-527-3887

For non-emergency assistance, call: 1-281-441-4400

Section 2: Composition and Information on Ingredients

Composition:

Name	CAS #	% by Weight
Toluene	108-88-3	100

Toxicological Data on Ingredients: Toluene: ORAL (LD50): Acute: 636 mg/kg [Rat]. DERMAL (LD50): Acute: 14100 mg/kg [Rabbit]. VAPOR (LC50): Acute: 49000 mg/m 4 hours [Rat]. 440 ppm 24 hours [Mouse].

Section 3: Hazards Identification

Potential Acute Health Effects:
Hazardous in case of skin contact (irritant), of eye contact (irritant), of ingestion, of inhalation. Slightly hazardous in case of skin contact (permeator).

Potential Chronic Health Effects:
CARCINOGENIC EFFECTS: A4 (Not classifiable for human or animal.) by ACGIH, 3 (Not classifiable for human.) by IARC. MUTAGENIC EFFECTS: Not available. TERATOGENIC EFFECTS: Not available. DEVELOPMENTAL TOXICITY: Not available. The substance may be toxic to blood, kidneys, the nervous system, liver, brain, central nervous system (CNS). Repeated or prolonged exposure to the substance can produce target organs damage.

Section 4: First Aid Measures

Eye Contact:
Check for and remove any contact lenses. In case of contact, immediately flush eyes with plenty of water for at least 15 minutes. Get medical attention.

Skin Contact:
In case of contact, immediately flush skin with plenty of water. Cover the irritated skin with an emollient. Remove contaminated clothing and shoes. Wash clothing before reuse. Thoroughly clean shoes before reuse. Get medical attention.

Serious Skin Contact:
Wash with a disinfectant soap and cover the contaminated skin with an anti-bacterial cream. Seek immediate medical attention.

Inhalation:
If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention.

Serious Inhalation:
Evacuate the victim to a safe area as soon as possible. Loosen tight clothing such as a collar, tie, belt or waistband. If breathing is difficult, administer oxygen. If the victim is not breathing, perform mouth-to-mouth resuscitation. WARNING: It may be hazardous to the person providing aid to give mouth-to-mouth resuscitation when the inhaled material is toxic, infectious or corrosive. Seek medical attention.

Ingestion:
Do NOT induce vomiting unless directed to do so by medical personnel. Never give anything by mouth to an unconscious person. If large quantities of this material are swallowed, call a physician immediately. Loosen tight clothing such as a collar, tie, belt or waistband.

Serious Ingestion: Not available.

Section 5: Fire and Explosion Data

Flammability of the Product: Flammable.

Auto-Ignition Temperature: 480°C (896°F)

Flash Points: CLOSED CUP: 4.4444°C (40°F). (Setaflash) OPEN CUP: 16°C (60.8°F).

Flammable Limits: LOWER: 1.1% UPPER: 7.1%

Products of Combustion: These products are carbon oxides (CO, CO2).

Fire Hazards in Presence of Various Substances:
Flammable in presence of open flames and sparks, of heat. Non-flammable in presence of shocks.

Explosion Hazards in Presence of Various Substances:
Risks of explosion of the product in presence of mechanical impact: Not available. Risks of explosion of the product in presence of static discharge: Not available.

Fire Fighting Media and Instructions:
Flammable liquid, insoluble in water. SMALL FIRE: Use DRY chemical powder. LARGE FIRE: Use water spray or fog.

Special Remarks on Fire Hazards: Not available.

Special Remarks on Explosion Hazards:
Toluene forms explosive reaction with 1,3-dichloro-5,5-dimethyl-2,4-imidazolididione; dinitrogen tetraoxide; concentrated nitric acid, sulfuric acid + nitric acid; N2O4; AgClO4; BrF3; Uranium hexafluoride; sulfur dichloride. Also forms an explosive mixture with tetranitromethane.

Section 6: Accidental Release Measures

Small Spill: Absorb with an inert material and put the spilled material in an appropriate waste disposal.

Large Spill:
Toxic flammable liquid, insoluble or very slightly soluble in water. Keep away from heat. Keep away from sources of ignition. Stop leak if without risk. Absorb with DRY earth, sand or other non-combustible material. Do not get water inside container. Do not touch spilled material. Prevent entry into sewers, basements or confined areas; dike if needed. Call for assistance on disposal. Be careful that the product is not present at a concentration level above TLV. Check TLV on the MSDS and with local authorities.

Section 7: Handling and Storage

Precautions:
Keep away from heat. Keep away from sources of ignition. Ground all equipment containing material. Do not ingest. Do not breathe gas/fumes/ vapor/spray. Wear suitable protective clothing. In case of insufficient ventilation, wear suitable respiratory equipment. If ingested, seek medical advice immediately and show the container or the label. Avoid contact with skin and eyes. Keep away from incompatibles such as oxidizing agents.

Storage:
Store in a segregated and approved area. Keep container in a cool, well-ventilated area. Keep container tightly closed and sealed until ready for use. Avoid all possible sources of ignition (spark or flame).

Section 8: Exposure Controls/Personal Protection

Engineering Controls:
Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapors below their respective threshold limit value. Ensure that eyewash stations and safety showers are proximal to the work-station location.

Personal Protection:
Splash goggles. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Gloves.

Personal Protection in Case of a Large Spill:
Splash goggles. Full suit. Vapor respirator. Boots. Gloves. A self contained breathing apparatus should be used to avoid inhalation of the product. Suggested protective clothing might not be sufficient; consult a specialist BEFORE handling this product.

Exposure Limits:
TWA: 200 STEL: 500 CEIL: 300 (ppm) from OSHA (PEL) [United States] TWA: 50 (ppm) from ACGIH (TLV) [United States] SKIN TWA: 100 STEL: 150 from NIOSH [United States] TWA: 375 STEL: 560 (mg/m3) from NIOSH [United States] Consult local authorities for acceptable exposure limits.

Section 9: Physical and Chemical Properties

Physical state and appearance: Liquid.

Odor: Sweet, pungent, Benzene-like.

Taste: Not available.

Molecular Weight: 92.14 g/mole

Color: Colorless.

pH (1% soln/water): Not applicable.

Boiling Point: 110.6°C (231.1°F)

Melting Point: -95°C (-139°F)

Critical Temperature: 318.6°C (605.5°F)

Specific Gravity: 0.8636 (Water = 1)

Vapor Pressure: 3.8 kPa (@ 25°C)

Vapor Density: 3.1 (Air = 1)

Volatility: Not available.

Odor Threshold: 1.6 ppm

Water/Oil Dist. Coeff.: The product is more soluble in oil; log(oil/water) = 2.7

Ionicity (in Water): Not available.

Dispersion Properties: See solubility in water, diethyl ether, acetone.

Solubility:
Soluble in diethyl ether, acetone. Practically insoluble in cold water. Soluble in ethanol, benzene, chloroform, glacial acetic acid, carbon disulfide. Solubility in water: 0.561 g/l @ 25 deg. C.

Section 10: Stability and Reactivity Data

Stability: The product is stable.

Instability Temperature: Not available.

Conditions of Instability: Heat, ignition sources (flames, sparks, static), incompatible materials

Incompatibility with various substances: Reactive with oxidizing agents.

Corrosivity: Non-corrosive in presence of glass.

Special Remarks on Reactivity:
Incompatible with strong oxidizers, silver perchlorate, sodium difluoride, Tetranitromethane, Uranium Hexafluoride. Frozen Bromine Trifluoride reacts violently with Toluene at -80 deg. C. Reacts chemically with nitrogen oxides, or halogens to form nitrotoluene, nitrobenzene, and nitrophenol and halogenated products, respectively.

Special Remarks on Corrosivity: Not available.

Polymerization: Will not occur.

Section 11: Toxicological Information

Routes of Entry: Absorbed through skin. Dermal contact. Eye contact. Inhalation. Ingestion.

Toxicity to Animals:
WARNING: THE LC50 VALUES HEREUNDER ARE ESTIMATED ON THE BASIS OF A 4-HOUR EXPOSURE. Acute oral toxicity (LD50): 636 mg/kg [Rat]. Acute dermal toxicity (LD50): 14100 mg/kg [Rabbit]. Acute toxicity of the vapor (LC50): 440 24 hours [Mouse].

Chronic Effects on Humans:
CARCINOGENIC EFFECTS: A4 (Not classifiable for human or animal.) by ACGIH, 3 (Not classifiable for human.) by IARC. May cause damage to the following organs: blood, kidneys, the nervous system, liver, brain, central nervous system (CNS).

Other Toxic Effects on Humans:
Hazardous in case of skin contact (irritant), of ingestion, of inhalation. Slightly hazardous in case of skin contact (permeator).

Special Remarks on Toxicity to Animals:
Lowest Published Lethal Dose: LDL [Human] - Route: Oral; Dose: 50 mg/kg LCL [Rabbit] - Route: Inhalation; Dose: 55000 ppm/40min

Special Remarks on Chronic Effects on Humans:
Detected in maternal milk in human. Passes through the placental barrier in human. Embryotoxic and/or foetotoxic in animal. May cause adverse reproductive effects and birth defects (teratogenic). May affect genetic material (mutagenic)

Special Remarks on other Toxic Effects on Humans:

Acute Potential Health Effects: Skin: Causes mild to moderate skin irritation. It can be absorbed to some extent through the skin. Eyes: Cauess mild to moderate eye irritation with a burning sensation. Splash contact with eyes also causes conjunctivitis, blepharospasm, corneal edema, corneal abraisons. This usually resolves in 2 days. Inhalation: Inhalation of vapor may cause respiratory tract irritation causing coughing and wheezing, and nasal discharge. Inhalation of high concentrations may affect behavior and cause central nervous system effects characterized by nausea, headache, dizziness, tremors, restlessness, lightheadedness, exhilaration, memory loss, insomnia, impaired reaction time, drowsiness, ataxia, hallucinations, somnolence, muscle contraction or spasticity, unconsciousness and coma. Inhalation of high concentration of vapor may also affect the cardiovascular system (rapid heart beat, heart palpitations, increased or decreased blood pressure, dysrhythmia,), respiration (acute pulmonary edema, respiratory depression, apnea, asphyxia), cause vision disturbances and dilated pupils, and cause loss of appetite. Ingestion: Aspiration hazard. Aspiration of Toluene into the lungs may cause chemical pneumonitis. May cause irritation of the digestive tract with nausea, vomiting, pain. May have effects similar to that of acute inhalation. Chronic Potential Health Effects: Inhalation and Ingestion: Prolonged or repeated exposure via inhalation may cause central nervous system and cardiovascular symptoms similar to that of acute inhalation and ingestion as well liver damage/failure, kidney damage/failure (with hematuria, proteinuria, oliguria, renal tubular acidosis), brain damage, weight loss, blood (pigmented or nucleated red blood cells, changes in white blood cell count), bone marrow changes, electrolyte imbalances (Hypokalemia, Hypophostatemia), severe, muscle weakness and Rhabdomyolysis. Skin: Repeated or prolonged skin contact may cause defatting dermatitis.

Section 12: Ecological Information

Ecotoxicity:
Ecotoxicity in water (LC50): 313 mg/l 48 hours [Daphnia (daphnia)]. 17 mg/l 24 hours [Fish (Blue Gill)]. 13 mg/l 96 hours [Fish (Blue Gill)]. 56 mg/l 24 hours [Fish (Fathead minnow)]. 34 mg/l 96 hours [Fish (Fathead minnow)]. 56.8 ppm any hours [Fish (Goldfish)].

BOD5 and COD: Not available.

Products of Biodegradation:
Possibly hazardous short term degradation products are not likely. However, long term degradation products may arise.

Toxicity of the Products of Biodegradation: The products of degradation are less toxic than the product itself.

Special Remarks on the Products of Biodegradation: Not available.

Section 13: Disposal Considerations

Waste Disposal:
Waste must be disposed of in accordance with federal, state and local environmental control regulations.

Section 14: Transport Information

DOT Classification: CLASS 3: Flammable liquid.

Identification: : Toluene UNNA: 1294 PG: II

Special Provisions for Transport: Not available.

Section 15: Other Regulatory Information

Federal and State Regulations:
California prop. 65: This product contains the following ingredients for which the State of California has found to cause cancer, birth defects or other reproductive harm, which would require a warning under the statute: Toluene California prop. 65 (no significant risk level): Toluene: 7 mg/day (value) California prop. 65 (acceptable daily intake level): Toluene: 7 mg/day (value) California prop. 65: This product contains the following ingredients for which the State of California has found to cause birth defects which would require a warning under the statute: Toluene Connecticut hazardous material survey.: Toluene Illinois

toxic substances disclosure to employee act: Toluene Illinois chemical safety act: Toluene New York release reporting list: Toluene Rhode Island RTK hazardous substances: Toluene Pennsylvania RTK: Toluene Florida: Toluene Minnesota: Toluene Michigan critical material: Toluene Massachusetts RTK: Toluene Massachusetts spill list: Toluene New Jersey: Toluene New Jersey spill list: Toluene Louisiana spill reporting: Toluene California Director's List of Hazardous Substances.: Toluene TSCA 8(b) inventory: Toluene TSCA 8(d) H and S data reporting: Toluene: Effective date: 10/04/82; Sunset Date: 10/0/92 SARA 313 toxic chemical notification and release reporting: Toluene CERCLA: Hazardous substances.: Toluene: 1000 lbs. (453.6 kg)

Other Regulations:
OSHA: Hazardous by definition of Hazard Communication Standard (29 CFR 1910.1200). EINECS: This product is on the European Inventory of Existing Commercial Chemical Substances.

Other Classifications:

WHMIS (Canada):
CLASS B-2: Flammable liquid with a flash point lower than 37.8°C (100°F). CLASS D-2A: Material causing other toxic effects (VERY TOXIC).

DSCL (EEC):
R11- Highly flammable. R20- Harmful by inhalation. S16- Keep away from sources of ignition - No smoking. S25- Avoid contact with eyes. S29- Do not empty into drains. S33- Take precautionary measures against static discharges.

HMIS (U.S.A.):

Health Hazard: 2

Fire Hazard: 3

Reactivity: 0

Personal Protection: h

National Fire Protection Association (U.S.A.):

Health: 2

Flammability: 3

Reactivity: 0

Specific hazard:

Protective Equipment:
Gloves. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate. Splash goggles.

Section 16: Other Information

References: Not available.

Other Special Considerations: Not available.

Created: 10/10/2005 08:30 PM

Last Updated: 11/06/2008 12:00 PM

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no event shall ScienceLab.com be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if ScienceLab.com has been advised of the possibility of such damages.

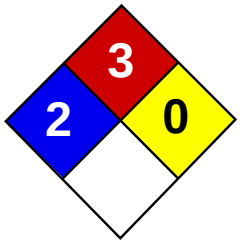

Material Safety Data Sheet
Ethylbenzene MSDS

Section 1: Chemical Product and Company Identification

Product Name: Ethylbenzene

Catalog Codes: SLE2044

CAS#: 100-41-4

RTECS: DA0700000

TSCA: TSCA 8(b) inventory: Ethylbenzene

CI#: Not available.

Synonym: Ethyl Benzene; Ethylbenzol; Phenylethane

Chemical Name: Ethylbenzene

Chemical Formula: C8H10

Contact Information:

Sciencelab.com, Inc.
14025 Smith Rd.
Houston, Texas 77396

US Sales: **1-800-901-7247**
International Sales: **1-281-441-4400**

Order Online: ScienceLab.com

CHEMTREC (24HR Emergency Telephone), call: 1-800-424-9300

International CHEMTREC, call: 1-703-527-3887

For non-emergency assistance, call: 1-281-441-4400

Section 2: Composition and Information on Ingredients

Composition:

Name	CAS #	% by Weight
Ethylbenzene	100-41-4	100

Toxicological Data on Ingredients: Ethylbenzene: ORAL (LD50): Acute: 3500 mg/kg [Rat].

Section 3: Hazards Identification

Potential Acute Health Effects:
Hazardous in case of eye contact (irritant), of ingestion, of inhalation. Slightly hazardous in case of skin contact (irritant, permeator).

Potential Chronic Health Effects:
Slightly hazardous in case of skin contact (irritant, sensitizer). CARCINOGENIC EFFECTS: Classified 2B (Possible for human.) by IARC. MUTAGENIC EFFECTS: Mutagenic for mammalian somatic cells. Mutagenic for bacteria and/or yeast. TERATOGENIC EFFECTS: Not available. DEVELOPMENTAL TOXICITY: Not available. The substance may be toxic to central nervous system (CNS). Repeated or prolonged exposure to the substance can produce target organs damage.

Section 4: First Aid Measures

Eye Contact:

Check for and remove any contact lenses. In case of contact, immediately flush eyes with plenty of water for at least 15 minutes. Cold water may be used. WARM water MUST be used. Get medical attention.

Skin Contact: Wash with soap and water. Cover the irritated skin with an emollient. Get medical attention if irritation develops.

Serious Skin Contact: Not available.

Inhalation:
If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention.

Serious Inhalation:
Evacuate the victim to a safe area as soon as possible. Loosen tight clothing such as a collar, tie, belt or waistband. If breathing is difficult, administer oxygen. If the victim is not breathing, perform mouth-to-mouth resuscitation. WARNING: It may be hazardous to the person providing aid to give mouth-to-mouth resuscitation when the inhaled material is toxic, infectious or corrosive. Seek medical attention.

Ingestion:
Do NOT induce vomiting unless directed to do so by medical personnel. Never give anything by mouth to an unconscious person. Loosen tight clothing such as a collar, tie, belt or waistband. Get medical attention if symptoms appear.

Serious Ingestion: Not available.

Section 5: Fire and Explosion Data

Flammability of the Product: Flammable.

Auto-Ignition Temperature: 432°C (809.6°F)

Flash Points:
CLOSED CUP: 15°C (59°F). (Tagliabue.) OPEN CUP: 26.667°C (80°F) (Cleveland) (CHRIS, 2001) CLOSED CUP: 12.8 C (55 F) (Bingham et al, 2001; NIOSH, 2001) CLOSED CUP: 21 C (70 F) (NFPA)

Flammable Limits: LOWER: 0.8% - 1.6%UPPER: 6.7% - 7%

Products of Combustion: These products are carbon oxides (CO, CO2).

Fire Hazards in Presence of Various Substances: Highly flammable in presence of open flames and sparks, of heat.

Explosion Hazards in Presence of Various Substances:
Risks of explosion of the product in presence of mechanical impact: Not available. Risks of explosion of the product in presence of static discharge: Not available. Slightly explosive in presence of heat.

Fire Fighting Media and Instructions:
Flammable liquid, soluble or dispersed in water. SMALL FIRE: Use DRY chemical powder. LARGE FIRE: Use alcohol foam, water spray or fog.

Special Remarks on Fire Hazards:
Vapor may travel considerable distance to source of ignition and flash back. Vapors may form explosive mixtures with air. When heated to decomposition it emits acrid smoke and irritating fumes.

Special Remarks on Explosion Hazards: Vapors may form explosive mixtures in air.

Section 6: Accidental Release Measures

Small Spill: Absorb with an inert material and put the spilled material in an appropriate waste disposal.

Large Spill:
Flammable liquid. Keep away from heat. Keep away from sources of ignition. Stop leak if without risk. Absorb with DRY earth, sand or other non-combustible material. Do not touch spilled material. Prevent entry into sewers, basements or confined areas; dike if needed. Be careful that the product is not present at a concentration level above TLV. Check TLV on the MSDS and with local authorities.

Section 7: Handling and Storage

Precautions:
Keep away from heat. Keep away from sources of ignition. Ground all equipment containing material. Do not ingest. Do not breathe gas/fumes/ vapor/spray. Avoid contact with eyes. Wear suitable protective clothing. In case of insufficient ventilation, wear suitable respiratory equipment. If ingested, seek medical advice immediately and show the container or the label. Keep away from incompatibles such as oxidizing agents.

Storage:
Store in a segregated and approved area. Keep container in a cool, well-ventilated area. Keep container tightly closed and sealed until ready for use. Avoid all possible sources of ignition (spark or flame). Sensitive to light. Store in light-resistant containers.

Section 8: Exposure Controls/Personal Protection

Engineering Controls:
Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapors below their respective threshold limit value. Ensure that eyewash stations and safety showers are proximal to the work-station location.

Personal Protection:
Splash goggles. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Gloves.

Personal Protection in Case of a Large Spill:
Splash goggles. Full suit. Vapor respirator. Boots. Gloves. A self contained breathing apparatus should be used to avoid inhalation of the product. Suggested protective clothing might not be sufficient; consult a specialist BEFORE handling this product.

Exposure Limits:
TWA: 100 STEL: 125 (ppm) from OSHA (PEL) [United States] TWA: 435 STEL: 545 from OSHA (PEL) [United States] TWA: 435 STEL: 545 (mg/m3) from NIOSH [United States] TWA: 100 STEL: 125 (ppm) from NIOSH [United States] TWA: 100 STEL: 125 (ppm) from ACGIH (TLV) [United States] TWA: 100 STEL: 125 (ppm) [United Kingdom (UK)] TWA: 100 STEL: 125 (ppm) [Belgium] TWA: 100 STEL: 125 (ppm) [Finland] TWA: 50 (ppm) [Norway] Consult local authorities for acceptable exposure limits.

Section 9: Physical and Chemical Properties

Physical state and appearance: Liquid.

Odor: Sweetish. Gasoline-like. Aromatic.

Taste: Not available.

Molecular Weight: 106.16 g/mole

Color: Colorless.

pH (1% soln/water): Not available.

Boiling Point: 136°C (276.8°F)

Melting Point: -94.9 (-138.8°F)

Critical Temperature: 617.15°C (1142.9°F)

Specific Gravity: 0.867 (Water = 1)

Vapor Pressure: 0.9 kPa (@ 20°C)

Vapor Density: 3.66 (Air = 1)

Volatility: 100% (v/v).

Odor Threshold: 140 ppm

Water/Oil Dist. Coeff.: The product is more soluble in oil; log(oil/water) = 3.1

Ionicity (in Water): Not available.

Dispersion Properties: See solubility in water, diethyl ether.

Solubility:
Easily soluble in diethyl ether. Very slightly soluble in cold water or practically insoluble in water. Soluble in all proportions in Ethyl alcohol. Soluble in Carbon tetrachloride, Benzene. Insoluble in Ammonia. Slightly soluble in Chloroform. Solubility in Water: 169 mg/l @ 25 deg. C.; 0.014 g/100 ml @ 15 deg. C.

Section 10: Stability and Reactivity Data

Stability: The product is stable.

Instability Temperature: Not available.

Conditions of Instability: Heat, ingnition sources (flames, sparks, static), incompatible materials, light

Incompatibility with various substances: Reactive with oxidizing agents.

Corrosivity: Not considered to be corrosive for metals and glass.

Special Remarks on Reactivity:
Can react vigorously with oxidizing materials. Sensitive to light.

Special Remarks on Corrosivity: Not available.

Polymerization: Will not occur.

Section 11: Toxicological Information

Routes of Entry: Absorbed through skin. Inhalation.

Toxicity to Animals: Acute oral toxicity (LD50): 3500 mg/kg [Rat].

Chronic Effects on Humans:
CARCINOGENIC EFFECTS: Classified 2B (Possible for human.) by IARC. MUTAGENIC EFFECTS: Mutagenic for mammalian somatic cells. Mutagenic for bacteria and/or yeast. May cause damage to the following organs: central nervous system (CNS).

Other Toxic Effects on Humans:
Hazardous in case of ingestion, of inhalation. Slightly hazardous in case of skin contact (irritant, permeator).

Special Remarks on Toxicity to Animals:
Lethal Dose/Conc 50% Kill: LD50 [Rabbit] - Route: Skin; Dose: 17800 ul/kg Lowest Published Lethal Dose/Conc: LDL[Rat] - Route: Inhalation (vapor); Dose: 4000 ppm/4 H

Special Remarks on Chronic Effects on Humans:
May cause adverse reproductive effects and birth defects (teratogenic) based on animal test data. May cause cancer based on animals data. IARC evidence for carcinogenicity in animals is sufficient. IARC evidence of carcinogenicity in humans inadequate. May affect genetic material (mutagenic).

Special Remarks on other Toxic Effects on Humans:
Acute Potential Health Effects: Skin: Can cause mild skin irritation. It can be absorbed through intact skin. Eyes: Contact with vapor or liquid can cause severe eye irritation depending on concentration. It may also cause conjunctivitis. At a vapor exposure level of 85 - 200 ppm , it is mildly and transiently irritating to the eyes; 1000 ppm causes further irritation and tearing; 2000 ppm results in immediate and severe irritation and tearing; 5,000 ppm is intolerable (ACGIH, 1991; Clayton and Clayton, 1994). Standard draize test for eye irritation using 500 mg resulted in severe irritation (RTECS) Inhalation: Exposure to high concentrations can cause nasal, mucous membrane and respiratory tract irritation and can also result in chest constriction and, trouble breathing, respiratory failure, and even death. It can also affect behavior/Central Nervous System. The effective dose for CNS depression in experimental animals was 10,000 ppm (ACGIH, 1991). Symptoms of CNS depression include

headache, nausea, weakness, dizziness, vertigo, irritability, fatigue, lightheadedness, sleepiness, tremor, loss of coordination, judgement and conciousness, coma, and death. It can also cause pulmonary edema. Inhalation of 85 ppm can produce fatigue, insomnia, headache, and mild irritation of the respiratory tract (Haley & Berndt, 1987). Ingestion: Do not drink, pipet or siphon by mouth. May cause gastroinestinal/digestive tract irritation with Abdominal pain, nausea, vomiting. Ethylbenzene is a pulmonary aspiration hazard. Pulmonary aspiration of even small amounts of the liquid may cause fatal pneumonitis. It may also affect behavior/central nervous system with

Section 12: Ecological Information

Ecotoxicity:
Ecotoxicity in water (LC50): 14 mg/l 96 hours [Fish (Trout)] (static). 12.1 mg/l 96 hours [Fish (Fathead Minnow)] (flow-through)]. 150 mg/l 96 hours [Fish (Blue Gill/Sunfish)] (static). 275 mg/l 96 hours [Fish (Sheepshead Minnow)]. 42.3 mg/l 96 hours [Fish (Fathead Minnow)](soft water). 87.6mg/l 96 hours [Shrimp].

BOD5 and COD: Not available.

Products of Biodegradation:
Possibly hazardous short term degradation products are not likely. However, long term degradation products may arise.

Toxicity of the Products of Biodegradation: The products of degradation are less toxic than the product itself.

Special Remarks on the Products of Biodegradation: Not available.

Section 13: Disposal Considerations

Waste Disposal:
Waste must be disposed of in accordance with federal, state and local environmental control regulations.

Section 14: Transport Information

DOT Classification: CLASS 3: Flammable liquid.

Identification: : Ethylbenzene UNNA: 1175 PG: II

Special Provisions for Transport: Not available.

Section 15: Other Regulatory Information

Federal and State Regulations:
Connecticut hazardous material survey.: Ethylbenzene Illinois toxic substances disclosure to employee act: Ethylbenzene Illinois chemical safety act: Ethylbenzene New York release reporting list: Ethylbenzene Rhode Island RTK hazardous substances: Ethylbenzene Pennsylvania RTK: Ethylbenzene Minnesota: Ethylbenzene Massachusetts RTK: Ethylbenzene Massachusetts spill list: Ethylbenzene New Jersey: Ethylbenzene New Jersey spill list: Ethylbenzene Louisiana spill reporting: Ethylbenzene California Director's List of Hazardous Substances: Ethylbenzene TSCA 8(b) inventory: Ethylbenzene TSCA 4(a) proposed test rules: Ethylbenzene TSCA 8(d) H and S data reporting: Ethylbenzene: Effective Date: 6/19/87; Sunset Date: 6/19/97 SARA 313 toxic chemical notification and release reporting: Ethylbenzene

Other Regulations:
OSHA: Hazardous by definition of Hazard Communication Standard (29 CFR 1910.1200). EINECS: This product is on the European Inventory of Existing Commercial Chemical Substances.

Other Classifications:

WHMIS (Canada):
CLASS B-2: Flammable liquid with a flash point lower than 37.8°C (100°F). CLASS D-2A: Material causing other toxic effects (VERY TOXIC). CLASSE D-2B: Material causing other toxic effects (TOXIC).

DSCL (EEC):
R11- Highly flammable. R20- Harmful by inhalation. S16- Keep away from sources of ignition - No smoking. S24/25- Avoid contact with skin and eyes. S29- Do not empty into drains.

HMIS (U.S.A.):

Health Hazard: 2

Fire Hazard: 3

Reactivity: 0

Personal Protection: h

National Fire Protection Association (U.S.A.):

Health: 2

Flammability: 3

Reactivity: 0

Specific hazard:

Protective Equipment:
Gloves. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate. Splash goggles.

Section 16: Other Information

References:
-Manufacturer's Material Safety Data Sheet. -Fire Protection Guide to Hazardous Materials, 13th ed., National Fire Protection Association (NFPA) -Registry of Toxic Effects of Chemical Substances (RTECS) -Chemical Hazard Response Information System (CHRIS) -Hazardous Substance Data Bank (HSDB) -New Jersey Hazardous Substance Fact Sheet -Ariel Global View -Reprotext System

Other Special Considerations: Not available.

Created: 10/09/2005 05:28 PM

Last Updated: 11/06/2008 12:00 PM

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no event shall ScienceLab.com be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if ScienceLab.com has been advised of the possibility of such damages.

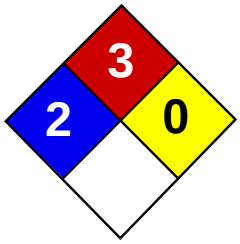

Material Safety Data Sheet
Xylenes MSDS

Section 1: Chemical Product and Company Identification

Product Name: Xylenes

Catalog Codes: SLX1075, SLX1129, SLX1042, SLX1096

CAS#: 1330-20-7

RTECS: ZE2100000

TSCA: TSCA 8(b) inventory: Xylenes

CI#: Not available.

Synonym: Xylenes; Dimethylbenzene; xylol; methyltoluene

Chemical Name: Xylenes (o-, m-, p- isomers)

Chemical Formula: C6H4(CH3)2

Contact Information:

Sciencelab.com, Inc.
14025 Smith Rd.
Houston, Texas 77396

US Sales: **1-800-901-7247**
International Sales: **1-281-441-4400**

Order Online: ScienceLab.com

CHEMTREC (24HR Emergency Telephone), call: 1-800-424-9300

International CHEMTREC, call: 1-703-527-3887

For non-emergency assistance, call: 1-281-441-4400

Section 2: Composition and Information on Ingredients

Composition:

Name	CAS #	% by Weight
Xylenes	1330-20-7	100

Toxicological Data on Ingredients: Xylenes: ORAL (LD50): Acute: 4300 mg/kg [Rat]. 2119 mg/kg [Mouse]. DERMAL (LD50): Acute: >1700 mg/kg [Rabbit].

Section 3: Hazards Identification

Potential Acute Health Effects: Hazardous in case of skin contact (irritant, permeator), of eye contact (irritant), of ingestion, of inhalation.

Potential Chronic Health Effects:
CARCINOGENIC EFFECTS: 3 (Not classifiable for human.) by IARC. MUTAGENIC EFFECTS: Not available. TERATOGENIC EFFECTS: Not available. DEVELOPMENTAL TOXICITY: Not available. The substance may be toxic to blood, kidneys, liver, mucous membranes, bone marrow, central nervous system (CNS). Repeated or prolonged exposure to the substance can produce target organs damage.

Section 4: First Aid Measures

Eye Contact:

Check for and remove any contact lenses. In case of contact, immediately flush eyes with plenty of water for at least 15 minutes. Get medical attention.

Skin Contact:
In case of contact, immediately flush skin with plenty of water. Cover the irritated skin with an emollient. Remove contaminated clothing and shoes. Wash clothing before reuse. Thoroughly clean shoes before reuse. Get medical attention.

Serious Skin Contact:
Wash with a disinfectant soap and cover the contaminated skin with an anti-bacterial cream. Seek immediate medical attention.

Inhalation:
If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention if symptoms appear.

Serious Inhalation:
Evacuate the victim to a safe area as soon as possible. Loosen tight clothing such as a collar, tie, belt or waistband. If breathing is difficult, administer oxygen. If the victim is not breathing, perform mouth-to-mouth resuscitation. Seek medical attention.

Ingestion:
Do NOT induce vomiting unless directed to do so by medical personnel. Never give anything by mouth to an unconscious person. Loosen tight clothing such as a collar, tie, belt or waistband. Get medical attention if symptoms appear.

Serious Ingestion: Not available.

Section 5: Fire and Explosion Data

Flammability of the Product: Flammable.

Auto-Ignition Temperature: 464°C (867.2°F)

Flash Points: CLOSED CUP: 24°C (75.2°F). (Tagliabue.) OPEN CUP: 37.8°C (100°F).

Flammable Limits: LOWER: 1% UPPER: 7%

Products of Combustion: These products are carbon oxides (CO, CO2).

Fire Hazards in Presence of Various Substances:
Highly flammable in presence of open flames and sparks, of heat. Non-flammable in presence of shocks.

Explosion Hazards in Presence of Various Substances:
Risks of explosion of the product in presence of mechanical impact: Not available. Slightly explosive in presence of open flames and sparks, of heat.

Fire Fighting Media and Instructions:
Flammable liquid, soluble or dispersed in water. SMALL FIRE: Use DRY chemical powder. LARGE FIRE: Use alcohol foam, water spray or fog. Cool containing vessels with water jet in order to prevent pressure build-up, autoignition or explosion.

Special Remarks on Fire Hazards: Vapors may travel to source of ignition and flash back.

Special Remarks on Explosion Hazards:
Vapors may form explosive mixtures with air. Containers may explode when heated. May polymerize explosively when heated. An attempt to chlorinate xylene with 1,3-Dichloro-5,5-dimethyl-2,4-imidazolidindione (dichlorohydrantoin) caused a violent explosion

Section 6: Accidental Release Measures

Small Spill: Absorb with an inert material and put the spilled material in an appropriate waste disposal.

Large Spill:
Flammable liquid. Keep away from heat. Keep away from sources of ignition. Stop leak if without risk. Absorb with DRY earth, sand or other non-combustible material. Do not touch spilled material. Prevent entry into sewers, basements or confined

areas; dike if needed. Be careful that the product is not present at a concentration level above TLV. Check TLV on the MSDS and with local authorities.

Section 7: Handling and Storage

Precautions:
Keep away from heat. Keep away from sources of ignition. Ground all equipment containing material. Do not ingest. Do not breathe gas/fumes/ vapor/spray. Wear suitable protective clothing. In case of insufficient ventilation, wear suitable respiratory equipment. If ingested, seek medical advice immediately and show the container or the label. Avoid contact with skin and eyes. Keep away from incompatibles such as oxidizing agents, acids.

Storage:
Store in a segregated and approved area. Keep container in a cool, well-ventilated area. Keep container tightly closed and sealed until ready for use. Avoid all possible sources of ignition (spark or flame).

Section 8: Exposure Controls/Personal Protection

Engineering Controls:
Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapors below their respective threshold limit value. Ensure that eyewash stations and safety showers are proximal to the work-station location.

Personal Protection:
Splash goggles. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Gloves.

Personal Protection in Case of a Large Spill:
Splash goggles. Full suit. Vapor respirator. Boots. Gloves. A self contained breathing apparatus should be used to avoid inhalation of the product. Suggested protective clothing might not be sufficient; consult a specialist BEFORE handling this product.

Exposure Limits:
TWA: 100 (ppm) [Canada] TWA: 435 (mg/m3) [Canada] TWA: 434 STEL: 651 (mg/m3) from ACGIH (TLV) [United States] TWA: 100 STEL: 150 (ppm) from ACGIH (TLV) [United States] Consult local authorities for acceptable exposure limits.

Section 9: Physical and Chemical Properties

Physical state and appearance: Liquid.

Odor: Sweetish.

Taste: Not available.

Molecular Weight: 106.17 g/mole

Color: Colorless. Clear

pH (1% soln/water): Not available.

Boiling Point: 138.5°C (281.3°F)

Melting Point: -47.4°C (-53.3°F)

Critical Temperature: Not available.

Specific Gravity: 0.864 (Water = 1)

Vapor Pressure: 0.9 kPa (@ 20°C)

Vapor Density: 3.7 (Air = 1)

Volatility: Not available.

Odor Threshold: 1 ppm

Water/Oil Dist. Coeff.: The product is more soluble in oil; log(oil/water) = 3.1

Ionicity (in Water): Not available.

Dispersion Properties: Not available.

Solubility:
Insoluble in cold water, hot water. Miscible with absolute alcohol, ether, and many other organic liquids.

Section 10: Stability and Reactivity Data

Stability: The product is stable.

Instability Temperature: Not available.

Conditions of Instability: Heat, ignition sources, incompatibles

Incompatibility with various substances: Reactive with oxidizing agents, acids.

Corrosivity: Non-corrosive in presence of glass.

Special Remarks on Reactivity: Store away from acetic acid, nitric acid, chlorine, bromine, and fluorine.

Special Remarks on Corrosivity: Not available.

Polymerization: Will not occur.

Section 11: Toxicological Information

Routes of Entry: Absorbed through skin. Dermal contact. Eye contact. Inhalation.

Toxicity to Animals:
WARNING: THE LC50 VALUES HEREUNDER ARE ESTIMATED ON THE BASIS OF A 4-HOUR EXPOSURE. Acute oral toxicity (LD50): 2119 mg/kg [Mouse]. Acute dermal toxicity (LD50): >1700 mg/kg [Rabbit]. Acute toxicity of the vapor (LC50): 5000 4 hours [Rat].

Chronic Effects on Humans:
CARCINOGENIC EFFECTS: 3 (Not classifiable for human.) by IARC. May cause damage to the following organs: blood, kidneys, liver, mucous membranes, bone marrow, central nervous system (CNS).

Other Toxic Effects on Humans: Hazardous in case of skin contact (irritant, permeator), of ingestion, of inhalation.

Special Remarks on Toxicity to Animals:
Lowest Lethal Dose: LDL [Human] - Route: Oral; Dose: 50 mg/kg LCL [Man] - Route: Oral; Dose: 10000 ppm/6H

Special Remarks on Chronic Effects on Humans:
Detected in maternal milk in human. Passes through the placental barrier in animal. Embryotoxic and/or foetotoxic in animal. May cause adverse reproductive effects (male and femael fertility (spontaneous abortion and fetotoxicity)) and birth defects based animal data.

Special Remarks on other Toxic Effects on Humans:
Acute Potential Health Effects: Skin: Causes skin irritation. Can be absorbed through skin. Eyes: Causes eye irritation. Inhalation: Vapor causes respiratory tract and mucous membrane irritation. May affect central nervous system and behavior (General anesthetic/CNS depressant with effects including headache, weakness, memory loss, irritability, dizziness, giddiness, loss of coordination and judgement, respiratory depression/arrest or difficulty breathing, loss of appetite, nausea, vomiting, shivering, and possible coma and death). May also affects blood, sense organs, liver, and peripheral nerves. Ingestion: May cause gastrointestinal irritation including abdominal pain, vomiting, and nausea. May also affect liver and urinary system/ kidneys. May cause effects similar to those of acute inhalation. Chronic Potential Health Effects: Chronic inhalation may affect the urinary system (kidneys) blood (anemia), bone marrow (hyperplasia of bone marrow) brain/behavior/Central Nervous system. Chronic inhalation may alsocause mucosal bleeding. Chronic ingestion may affect the liver and metabolism (loss of appetite) and may affect urinary system (kidney damage)

Section 12: Ecological Information

Ecotoxicity: Not available.

BOD5 and COD: Not available.

Products of Biodegradation:
Possibly hazardous short term degradation products are not likely. However, long term degradation products may arise.

Toxicity of the Products of Biodegradation: The products of degradation are less toxic than the product itself.

Special Remarks on the Products of Biodegradation: Not available.

Section 13: Disposal Considerations

Waste Disposal:
Waste must be disposed of in accordance with federal, state and local environmental control regulations.

Section 14: Transport Information

DOT Classification: CLASS 3: Flammable liquid.

Identification: : Xylenes UNNA: 1307 PG: III

Special Provisions for Transport: Not available.

Section 15: Other Regulatory Information

Federal and State Regulations:
Connecticut hazardous material survey.: Xylenes Illinois chemical safety act: Xylenes New York acutely hazardous substances: Xylenes Rhode Island RTK hazardous substances: Xylenes Pennsylvania RTK: Xylenes Minnesota: Xylenes Michigan critical material: Xylenes Massachusetts RTK: Xylenes Massachusetts spill list: Xylenes New Jersey: Xylenes New Jersey spill list: Xylenes Louisiana spill reporting: Xylenes California Director's List of Hazardous Substances: Xylenes TSCA 8(b) inventory: Xylenes SARA 302/304/311/312 hazardous chemicals: Xylenes SARA 313 toxic chemical notification and release reporting: Xylenes CERCLA: Hazardous substances.: Xylenes: 100 lbs. (45.36 kg)

Other Regulations:
OSHA: Hazardous by definition of Hazard Communication Standard (29 CFR 1910.1200). EINECS: This product is on the European Inventory of Existing Commercial Chemical Substances.

Other Classifications:

WHMIS (Canada):
CLASS B-2: Flammable liquid with a flash point lower than 37.8°C (100°F). CLASS D-2A: Material causing other toxic effects (VERY TOXIC).

DSCL (EEC):
R10- Flammable. R21- Harmful in contact with skin. R36/38- Irritating to eyes and skin. S2- Keep out of the reach of children. S36/37- Wear suitable protective clothing and gloves. S46- If swallowed, seek medical advice immediately and show this container or label.

HMIS (U.S.A.):

Health Hazard: 2

Fire Hazard: 3

Reactivity: 0

Personal Protection: h

National Fire Protection Association (U.S.A.):

Health: 2

Flammability: 3

Reactivity: 0

Specific hazard:

Protective Equipment:
Gloves. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate. Splash goggles.

Section 16: Other Information

References: Not available.

Other Special Considerations: Not available.

Created: 10/11/2005 12:54 PM

Last Updated: 11/06/2008 12:00 PM

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no event shall ScienceLab.com be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if ScienceLab.com has been advised of the possibility of such damages.

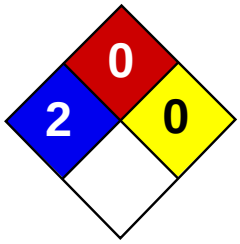

Health	2
Fire	0
Reactivity	0
Personal Protection	G

Material Safety Data Sheet
Tetrachloroethylene MSDS

Section 1: Chemical Product and Company Identification

Product Name: Tetrachloroethylene

Catalog Codes: SLT3220

CAS#: 127-18-4

RTECS: KX3850000

TSCA: TSCA 8(b) inventory: Tetrachloroethylene

CI#: Not available.

Synonym: Perchloroethylene; 1,1,2,2-Tetrachloroethylene; Carbon bichloride; Carbon dichloride; Ankilostin; Didakene; Dilatin PT; Ethene, tetrachloro-; Ethylene tetrachloride; Perawin; Perchlor; Perclene; Perclene D; Percosolvel; Tetrachloroethene; Tetraleno; Tetralex; Tetravec; Tetroguer; Tetropil

Chemical Name: Ethylene, tetrachloro-

Chemical Formula: C2-Cl4

Contact Information:

Sciencelab.com, Inc.
14025 Smith Rd.
Houston, Texas 77396

US Sales: **1-800-901-7247**
International Sales: **1-281-441-4400**

Order Online: ScienceLab.com

CHEMTREC (24HR Emergency Telephone), call: 1-800-424-9300

International CHEMTREC, call: 1-703-527-3887

For non-emergency assistance, call: 1-281-441-4400

Section 2: Composition and Information on Ingredients

Composition:

Name	CAS #	% by Weight
Tetrachloroethylene	127-18-4	100

Toxicological Data on Ingredients: Tetrachloroethylene: ORAL (LD50): Acute: 2629 mg/kg [Rat]. DERMAL (LD): Acute: >3228 mg/kg [Rabbit]. MIST(LC50): Acute: 34200 mg/m 8 hours [Rat]. VAPOR (LC50): Acute: 5200 ppm 4 hours [Mouse].

Section 3: Hazards Identification

Potential Acute Health Effects:
Hazardous in case of skin contact (irritant), of inhalation. Slightly hazardous in case of skin contact (permeator), of eye contact (irritant), of ingestion.

Potential Chronic Health Effects:
CARCINOGENIC EFFECTS: Classified A3 (Proven for animal.) by ACGIH. Classified 2A (Probable for human.) by IARC, 2 (anticipated carcinogen) by NTP. MUTAGENIC EFFECTS: Mutagenic for bacteria and/or yeast. TERATOGENIC EFFECTS: Not available. DEVELOPMENTAL TOXICITY: Not available. The substance may be toxic to kidneys, liver, peripheral nervous system, respiratory tract, skin, central nervous system (CNS). Repeated or prolonged exposure to the substance can produce target organs damage.

Section 4: First Aid Measures

Eye Contact:
Check for and remove any contact lenses. In case of contact, immediately flush eyes with plenty of water for at least 15 minutes. Get medical attention if irritation occurs.

Skin Contact:
In case of contact, immediately flush skin with plenty of water. Cover the irritated skin with an emollient. Remove contaminated clothing and shoes. Wash clothing before reuse. Thoroughly clean shoes before reuse. Get medical attention.

Serious Skin Contact:
Wash with a disinfectant soap and cover the contaminated skin with an anti-bacterial cream. Seek medical attention.

Inhalation:
If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention if symptoms appear.

Serious Inhalation:
Evacuate the victim to a safe area as soon as possible. Loosen tight clothing such as a collar, tie, belt or waistband. If breathing is difficult, administer oxygen. If the victim is not breathing, perform mouth-to-mouth resuscitation. Seek medical attention.

Ingestion:
Do NOT induce vomiting unless directed to do so by medical personnel. Never give anything by mouth to an unconscious person. Loosen tight clothing such as a collar, tie, belt or waistband. Get medical attention if symptoms appear.

Serious Ingestion: Not available.

Section 5: Fire and Explosion Data

Flammability of the Product: Non-flammable.

Auto-Ignition Temperature: Not applicable.

Flash Points: Not applicable.

Flammable Limits: Not applicable.

Products of Combustion: Not available.

Fire Hazards in Presence of Various Substances: Not applicable.

Explosion Hazards in Presence of Various Substances:
Risks of explosion of the product in presence of mechanical impact: Not available. Risks of explosion of the product in presence of static discharge: Not available.

Fire Fighting Media and Instructions: Not applicable.

Special Remarks on Fire Hazards: Not available.

Special Remarks on Explosion Hazards: Not available.

Section 6: Accidental Release Measures

Small Spill: Absorb with an inert material and put the spilled material in an appropriate waste disposal.

Large Spill:
Absorb with an inert material and put the spilled material in an appropriate waste disposal. Be careful that the product is not present at a concentration level above TLV. Check TLV on the MSDS and with local authorities.

Section 7: Handling and Storage

Precautions:
Do not ingest. Do not breathe gas/fumes/ vapor/spray. Avoid contact with skin. Wear suitable protective clothing. In case of insufficient ventilation, wear suitable respiratory equipment. If ingested, seek medical advice immediately and show the container or the label. Keep away from incompatibles such as oxidizing agents, metals, acids, alkalis.

Storage: Keep container tightly closed. Keep container in a cool, well-ventilated area.

Section 8: Exposure Controls/Personal Protection

Engineering Controls:
Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapors below their respective threshold limit value.

Personal Protection:
Safety glasses. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Gloves.

Personal Protection in Case of a Large Spill:
Splash goggles. Full suit. Vapor respirator. Boots. Gloves. A self contained breathing apparatus should be used to avoid inhalation of the product. Suggested protective clothing might not be sufficient; consult a specialist BEFORE handling this product.

Exposure Limits:
TWA: 25 (ppm) from OSHA (PEL) [United States] TWA: 25 STEL: 100 (ppm) from ACGIH (TLV) [United States] TWA: 170 (mg/m3) from OSHA (PEL) [United States] Consult local authorities for acceptable exposure limits.

Section 9: Physical and Chemical Properties

Physical state and appearance: Liquid.

Odor: Ethereal.

Taste: Not available.

Molecular Weight: 165.83 g/mole

Color: Clear Colorless.

pH (1% soln/water): Not available.

Boiling Point: 121.3°C (250.3°F)

Melting Point: -22.3°C (-8.1°F)

Critical Temperature: 347.1°C (656.8°F)

Specific Gravity: 1.6227 (Water = 1)

Vapor Pressure: 1.7 kPa (@ 20°C)

Vapor Density: 5.7 (Air = 1)

Volatility: Not available.

Odor Threshold: 5 - 50 ppm

Water/Oil Dist. Coeff.: The product is more soluble in oil; log(oil/water) = 3.4

Ionicity (in Water): Not available.

Dispersion Properties: Not available.

Solubility:
Miscible with alcohol, ether, chloroform, benzene, hexane. It dissolves in most of the fixed and volatile oils. Solubility in water: 0.015 g/100 ml @ 25 deg. C It slowly decomposes in water to yield Trichloroacetic and Hydrochloric acids.

Section 10: Stability and Reactivity Data

Stability: The product is stable.

Instability Temperature: Not available.

Conditions of Instability: Incompatible materials

Incompatibility with various substances: Reactive with oxidizing agents, metals, acids, alkalis.

Corrosivity: Non-corrosive in presence of glass.

Special Remarks on Reactivity:
Oxidized by strong oxidizing agents. Incompatible with sodium hydroxide, finely divided or powdered metals such as zinc, aluminum, magnesium, potassium, chemically active metals such as lithium, beryllium , barium. Protect from light.

Special Remarks on Corrosivity: Slowly corrodes aluminum, iron, and zinc.

Polymerization: Will not occur.

Section 11: Toxicological Information

Routes of Entry: Absorbed through skin. Eye contact. Inhalation. Ingestion.

Toxicity to Animals:
WARNING: THE LC50 VALUES HEREUNDER ARE ESTIMATED ON THE BASIS OF A 4-HOUR EXPOSURE. Acute oral toxicity (LD50): 2629 mg/kg [Rat]. Acute dermal toxicity (LD50): >3228 mg/kg [Rabbit]. Acute toxicity of the vapor (LC50): 5200 4 hours [Mouse].

Chronic Effects on Humans:
CARCINOGENIC EFFECTS: Classified A3 (Proven for animal.) by ACGIH. Classified 2A (Probable for human.) by IARC, 2 (Some evidence.) by NTP. MUTAGENIC EFFECTS: Mutagenic for bacteria and/or yeast. May cause damage to the following organs: kidneys, liver, peripheral nervous system, upper respiratory tract, skin, central nervous system (CNS).

Other Toxic Effects on Humans:
Hazardous in case of skin contact (irritant), of inhalation. Slightly hazardous in case of skin contact (permeator), of ingestion.

Special Remarks on Toxicity to Animals:
Lowest Publishe Lethal Dose/Conc: LDL [Rabbit] - Route: Oral; Dose: 5000 mg/kg LDL [Dog] - Route: Oral; Dose: 4000 mg/kg LDL [Cat] - Route: Oral; Dose: 4000 mg/kg

Special Remarks on Chronic Effects on Humans:
May cause adverse reproductive effects and birth defects(teratogenic). May affect genetic material (mutagenic). May cause cancer.

Special Remarks on other Toxic Effects on Humans:
Acute Potential Health Effects: Skin: Causes skin irritation with possible dermal blistering or burns. Symtoms may include redness, itching, pain, and possible dermal blistering or burns. It may be absorbed through the skin with possible systemic effects. A single prolonged skin exposure is not likely to result in the material being absorbed in harmful amounts. Eyes: Contact causes transient eye irritation, lacrimation. Vapors cause eye/conjunctival irritation. Symptoms may include redness and pain. Inhalation: The main route to occupational exposure is by inhalation since it is readily absorbed through the lungs. It causes respiratory tract irritation, . It can affect behavior/central nervous system (CNS depressant and anesthesia ranging from slight inebriation to death, vertigo, somnolence, anxiety, headache, excitement, hallucinations, muscle incoordination, dizziness, lightheadness, disorentiation, seizures, enotional instability, stupor, coma). It may cause pulmonary edema Ingestion: It can cause nausea, vomiting, anorexia, diarrhea, bloody stool. It may affect the liver, urinary system (proteinuria, hematuria, renal failure, renal tubular disorder), heart (arrhythmias). It may affect behavior/central nervous system with symptoms similar to that of inhalation. Chronic Potential Health Effects: Skin: Prolonged or repeated skin contact may result in excessive drying of the skin, and irritation. Ingestion/Inhalation: Chronic exposure can affect the liver(hepatitis,fatty liver degeneration), kidneys, spleen, and heart (irregular heartbeat/arrhythmias, cardiomyopathy, abnormal EEG), brain, behavior/ central nervous system/peripheral nervous system (impaired memory, numbness of extremeties, peripheral neuropathy and other

Section 12: Ecological Information

Ecotoxicity:
Ecotoxicity in water (LC50): 18.4 mg/l 96 hours [Fish (Fatthead Minnow)]. 18 mg/l 48 hours [Daphnia (daphnia)]. 5 mg/l 96 hours [Fish (Rainbow Trout)]. 13 mg/l 96 hours [Fish (Bluegill sunfish)].

BOD5 and COD: Not available.

Products of Biodegradation:
Possibly hazardous short term degradation products are not likely. However, long term degradation products may arise.

Toxicity of the Products of Biodegradation: The product itself and its products of degradation are not toxic.

Special Remarks on the Products of Biodegradation: Not available.

Section 13: Disposal Considerations

Waste Disposal:
Waste must be disposed of in accordance with federal, state and local environmental control regulations.

Section 14: Transport Information

DOT Classification: CLASS 6.1: Poisonous material.

Identification: : Tetrachloroethylene UNNA: 1897 PG: III

Special Provisions for Transport: Marine Pollutant

Section 15: Other Regulatory Information

Federal and State Regulations:
California prop. 65: This product contains the following ingredients for which the State of California has found to cause cancer, birth defects or other reproductive harm, which would require a warning under the statute: Tetrachloroethylene California prop. 65: This product contains the following ingredients for which the State of California has found to cause cancer which would require a warning under the statute: Tetrachloroethylene Connecticut hazardous material survey.: Tetrachloroethylene Illinois toxic substances disclosure to employee act: Tetrachloroethylene Illinois chemical safety act: Tetrachloroethylene New York release reporting list: Tetrachloroethylene Rhode Island RTK hazardous substances: Tetrachloroethylene Pennsylvania RTK: Tetrachloroethylene Minnesota: Tetrachloroethylene Michigan critical material: Tetrachloroethylene Massachusetts RTK: Tetrachloroethylene Massachusetts spill list: Tetrachloroethylene New Jersey: Tetrachloroethylene New Jersey spill list: Tetrachloroethylene Louisiana spill reporting: Tetrachloroethylene California Director's List of Hazardous Substances: Tetrachloroethylene TSCA 8(b) inventory: Tetrachloroethylene TSCA 8(d) H and S data reporting: Tetrachloroethylene: Effective date: 6/1/87; Sunset date: 6/1/97 SARA 313 toxic chemical notification and release reporting: Tetrachloroethylene CERCLA: Hazardous substances.: Tetrachloroethylene: 100 lbs. (45.36 kg)

Other Regulations:
OSHA: Hazardous by definition of Hazard Communication Standard (29 CFR 1910.1200). EINECS: This product is on the European Inventory of Existing Commercial Chemical Substances.

Other Classifications:

WHMIS (Canada):
CLASS D-1B: Material causing immediate and serious toxic effects (TOXIC). CLASS D-2A: Material causing other toxic effects (VERY TOXIC).

DSCL (EEC):
R40- Possible risks of irreversible effects. R51/53- Toxic to aquatic organisms, may cause long-term adverse effects in the aquatic environment. S23- Do not breathe gas/fumes/vapour/spray S26- In case of contact with eyes, rinse immediately with plenty of water and seek medical advice. S37- Wear suitable gloves. S61- Avoid release to the environment. Refer to special instructions/Safety data sheets.

HMIS (U.S.A.):

Health Hazard: 2

Fire Hazard: 0

Reactivity: 0

Personal Protection: g

National Fire Protection Association (U.S.A.):

Health: 2

Flammability: 0

Reactivity: 0

Specific hazard:

Protective Equipment:
Gloves. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate. Safety glasses.

Section 16: Other Information

References: Not available.

Other Special Considerations: Not available.

Created: 10/10/2005 08:29 PM

Last Updated: 05/21/2013 12:00 PM

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no event shall ScienceLab.com be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if ScienceLab.com has been advised of the possibility of such damages.

Manufactured for

INDUSTRIAL SCIENTIFIC

CORPORATION

1001 Oakdale Road
Oakdale, PA 15071-1500

Phone (412) 788-4353
TOLL-FREE 800-DETECTS
Fax (412) 788-8353

MATERIAL SAFETY DATA SHEET

Prepared to U.S. OSHA, CMA, ANSI and Canadian WHMIS Standards

1. PRODUCT IDENTIFICATION

CHEMICAL NAME; CLASS: NON-FLAMMABLE GAS MIXTURE

Containing One or More of the Following Components in a Nitrogen Balance Gas: Oxygen, 0.0015-23.5%; Propane, 0-1.1%; n-Pentane, 0-0.75%; n-Hexane; 0-0.48%; Carbon Monoxide, 0.0005-1.0%; Hydrogen Sulfide, 0.001-0.025%

NOTE: MIXTURES COMPRISED OF AN AIR BALANCE GAS CONTAIN BETWEEN 19.5-23.5% OXYGEN.

SYNONYMS: Not Applicable

CHEMICAL FAMILY NAME: Not Applicable

FORMULA: Not Applicable

Document Number: 50016 (Replaces ISC MSDS No.1810-2187, 1810-2343, 1810-3366, 1810-3937 1810-7219, 1810-7599, 1810-6179)

Note: The Material Safety Data Sheet is for this gas mixture supplied in cylinders with 33 cubic feet (935 liters) or less gas capacity (DOT - 39 cylinders). This MSDS has been developed for various gas mixtures with the composition of components within the ranges listed in Section 2 (Composition and Information on Ingredients). Refer to the product label for information on the actual composition of the product.

PRODUCT USE:	Calibration of Monitoring and Research Equipment
SUPPLIER/MANUFACTURER'S NAME:	CALGAZ
ADDRESS:	821 Chesapeake Drive Cambridge, MD 21613
EMERGENCY PHONE:	CHEMTREC: 1-800-424-9300
BUSINESS PHONE:	1-410-228-6400
General MSDS Information	1-713/868-0440
Fax on Demand:	1-800/231-1366

2. COMPOSITION and INFORMATION ON INGREDIENTS

CHEMICAL NAME	CAS #	mole %	EXPOSURE LIMITS IN AIR					
			ACGIHTLV		OSHA		IDLH	OTHER
			TWA ppm	STEL ppm	TWA ppm	STEL ppm	ppm	ppm
Oxygen	7782-44-7	0.0015 - 23.5%	There are no specific exposure limits for Oxygen. Oxygen levels should be maintained above 19.5%.					
Propane	74-98-6	0 - 1.1%	2500	NE	1000	NE	2100	NIOSH REL: 1000 DFG MAK: 1000 ppm
n-Pentane	109-66-0	0 - 0.75%	600	750	1000 600 (Vacated 1989 PEL)	750 (Vacated 1989 PEL)	1500	NIOSH REL: TWA = 120 STEL = 610 (ceiling) 15 minutes DFG MAKs: TWA =1000 PEAK = 2•MAK, 60 min., momentary value
n-Hexane	110-54-3	0 - 0.48%	50	NE	500 50 (Vacated 1989 PEL)	NE	1100	NIOSH REL: 50 DFG MAK: 50
Hydrogen Sulfide	7783-06-4	0.001-0.025 %	10 NIC = 5	15 NIC = 5	10 (Vacated 1989 PEL)	20 (ceiling), 50 (10 min. peak, once per shift) 15 (Vacated 1989 PEL)	100	NIOSH REL: STEL = 10 (ceiling), 10 minutes DFG MAKs: TWA = 10 PEAK = 2•MAK, 10 min., momentary value
Carbon Monoxide	630-08-0	0.0005 - 1.0%	25	NE	50 35 (Vacated 1989 PEL)	200 (ceiling) (Vacated 1989 PEL)	1200	NIOSH RELs: TWA = 35 STEL = 200 ceiling DFG MAKs: TWA = 30 PEAK = 2•MAK, 15 min., average value, 1 hr interval DFG MAK Pregnancy Risk Classification: B
Nitrogen	7727-37-9	Balance	There are no specific exposure limits for Nitrogen. Nitrogen is a simple asphyxiant (SA). Oxygen levels should be maintained above 19.5%.					

NE = Not Established. NIC = Notice of Intended Change See Section 16 for Definitions of Terms Used.

NOTE: ALL WHMIS required information is included in appropriate sections based on the ANSI Z400.1-1998 format. This gas mixture has been classified in accordance with the hazard criteria of the CPR and the MSDS contains all the information required by the CPR.

3. HAZARD IDENTIFICATION

EMERGENCY OVERVIEW: This gas mixture is a colorless gas which has a rotten-egg odor (due to the presence of Hydrogen Sulfide). The odor cannot be relied on as an adequate warning of the presence of this gas mixture, because olfactory fatigue occurs after over-exposure to Hydrogen Sulfide. Hydrogen Sulfide and Carbon Monoxide (another component of this gas mixture) are toxic to humans in relatively low concentrations. Over-exposure to this gas mixture can cause skin or eye irritation, nausea, dizziness, headaches, collapse, unconsciousness, coma, and death. The Propane, n-Pentane, and n-Hexane components can cause anesthetic or peripheral neuropathy effects. Additionally, releases of this gas mixture may produce oxygen-deficient atmospheres (especially in small confined spaces or other poorly-ventilated environments); individuals in such atmospheres may be asphyxiated.

SYMPTOMS OF OVER-EXPOSURE BY ROUTE OF EXPOSURE: The most significant route of over-exposure for this gas mixture is by inhalation.

INHALATION: Due to the small size of an individual cylinder of this gas mixture, no unusual health effects from over-exposure to the product are anticipated under routine circumstances of use. A significant health hazard associated with this gas mixture is the potential of inhalation of Hydrogen Sulfide, a component of this gas mixture. Such over-exposures may occur if this gas mixture is used in a confined space or other poorly-ventilated area. Over-exposures to Hydrogen Sulfide can cause dizziness, headache, and nausea. Exposure to this component can result in respiratory arrest, coma, or unconsciousness. Continuous inhalation of low concentrations of Hydrogen Sulfide may cause olfactory fatigue, so that the odor is no longer an effective warning of the presence of this gas. A summary of exposure concentrations and observed effects are as follows

CONCENTRATION OF HYDROGEN SULFIDE	OBSERVED EFFECT
0.3-30 ppm	Odor is obvious and unpleasant.
50 ppm	Eye irritation. Dryness and irritation of nose, throat.
Slightly higher than 50 ppm	Irritation of the respiratory system.
100-150 ppm	Temporary loss of smell.
200-250 ppm	Headache, vomiting nausea. Prolonged exposure may lead to lung damage. Exposures of 4-8 hours can be fatal.
300-500	Swifter onset of symptoms. Death occurs in 1-4 hours.
500 ppm	Headache, excitement, staggering, and stomach ache after brief exposure. Death occurs within 0.5 - 1 hour of exposure.
> 600 ppm	Rapid onset of unconsciousness, coma, death.
> 1000 ppm	Immediate respiratory arrest.
NOTE:	This gas mixture contains a maximum of 250 ppm Hydrogen Sulfide. The higher concentration values here are presented to delineate the complete health effects which have been observed for humans after exposure to Hydrogen Sulfide.

HAZARDOUS MATERIAL IDENTIFICATION SYSTEM

HEALTH HAZARD	(BLUE)	3
FLAMMABILITY HAZARD	(RED)	0
PHYSICAL HAZARD	(YELLOW)	0

PROTECTIVE EQUIPMENT

EYES	RESPIRATORY	HANDS	BODY
See Section 8			

For Routine Industrial Use and Handling Applications

Inhalation over-exposures to atmospheres containing more than the Threshold Limit Value of Carbon Monoxide (25 ppm), another component of this gas mixture, can result in serious health consequences. Carbon Monoxide is classified as a chemical asphyxiant, producing a toxic action by combining with the hemoglobin of the blood and replacing the available oxygen. Through this replacement, the body is deprived of the required oxygen, and asphyxiation occurs.

Since the affinity of Carbon Monoxide for hemoglobin is about 200-300 times that of oxygen, only a small amount of Carbon Monoxide will cause a toxic reaction to occur. Carbon Monoxide exposures in excess of 50 ppm will produce symptoms of poisoning if breathed for a sufficiently long time. If this gas mixture is released in a small, poorly ventilated area (i.e. an enclosed or confined space), symptoms which may develop include the following:

CONCENTRATION OF CARBON MONOXIDE	OBSERVED EFFECT
All exposure levels: ..	Over-exposure to Carbon Monoxide can be indicated by the lips and fingernails turning bright red.
200 ppm:	Slight symptoms (i.e. headache) after several hours of exposure.
400 ppm:	Headache and discomfort experienced within 2-3 hours of exposure.
1,000 -2000 ppm:	Within 30 minutes, slight palpitations of the heart occurs. Within 1.5 hours, there is a tendency to stagger.
200-2500 ppm:	Within 2 hours, there is mental confusion, headaches, and nausea. Unconsciousness within 30 minutes.
> 2500 ppm:	Potential for collapse and death before warning symptoms.

Another hazard associated with this gas mixture is the potential for anesthetic and peripheral neuropathy effects after inhalation over-exposures to the Propane, n-Pentane and n-Hexane components of this gas mixture. Specific human over-exposure data are available for n-Pentane and n-Hexane, as follows:

CONCENTRATION OF n-PENTANE	OBSERVED EFFECT
Brief (10 minute) up to 5,000 ppm:	No symptoms.
Higher than 5,000 ppm:	Exhilaration, dizziness and headache can occur.
Long term:	Can cause chronic neurological disorder causing damage to the nerves in the hands and feet (peripheral neuropathy)

CONCENTRATION OF n-HEXANE	OBSERVED EFFECT
Brief (10 minute) at 1,500 ppm:	Irritation of the respiratory tract, nausea and headache.
5000 ppm:	Dizziness and drowsiness can occur.
Long term at 500 ppm:	Can affect the nerves in the arms and legs. Effects include numbing or tingling sensations in the fingers and toes, tiredness, muscle weakness, cramps and spasms in the leg, difficulty in holding objects or walking, abdominal pains, loss of appetite, weight loss. More serious exposures can cause damage to the nerves in the hands and feet (peripheral neuropathy).
Eyes and Vision:	Abnormal color perception and pigment changes in the eyes have been reported among industrial workers exposed to 423-1280 ppm for 5 years or more.
Blood Cells:	Mild forms of anemia have also been associated with exposure to hexane. These are of temporary nature.

Additionally, if mixtures of this gas mixture contain less than 19.5% Oxygen and are released in a small, poorly ventilated area (i.e. an enclosed or confined space), an oxygen-deficient environment may occur. Individuals breathing such an atmosphere may experience symptoms which include headaches, ringing in ears, dizziness, drowsiness, unconsciousness, nausea, vomiting, and depression of all the senses. Under some circumstances of over-exposure, death may occur. The following effects associated with various levels of oxygen are as follows:

CONCENTRATION OF OXYGEN	OBSERVED EFFECT
12-16% Oxygen:	Breathing and pulse rate increased, muscular coordination slightly disturbed.
10-14% Oxygen:	Emotional upset, abnormal fatigue, disturbed respiration.
6-10% Oxygen:	Nausea, vomiting, collapse, or loss of consciousness.
Below 6%:	Convulsive movements, possible respiratory collapse, and death.

SKIN and EYE CONTACT: The Hydrogen Sulfide component of this gas mixture may be irritating to the skin. Inflammation and irritation of the eyes can occur at very low airborne concentration of Hydrogen Sulfide (less than 10 ppm). Exposure over several hours may result in “gas eyes” or “sore eyes” with symptoms of scratchiness, irritation, tearing and burning. Above 50 ppm of Hydrogen Sulfide, there is an intense tearing, blurring of vision, and pain when looking at light. Over-exposed individuals may see rings around bright lights. Most symptoms disappear when exposure ceases. However, in serious cases, the eye can be permanently damaged.

HEALTH EFFECTS OR RISKS FROM EXPOSURE: An Explanation in Lay Terms. Over-exposure to this gas mixture may cause the following health effects:

ACUTE: Due to the small size of the individual cylinder of this gas mixture, no unusual health effects from exposure to the product are anticipated under routine circumstances of use. However, the Hydrogen Sulfide and Carbon Monoxide components of this gas mixture are toxic to humans. Over-exposure to this gas mixture can cause nausea, dizziness, headaches, collapse, unconsciousness, coma, and death. Due to the presence of Hydrogen Sulfide, over-exposures to this gas mixture can also irritate the skin and eyes; severe eye contamination can result in blindness.

Inhalation over-exposures to Propane, n-Pentane, and n-Hexane can cause anesthetic effects and motor neuropathy (i.e. pain and tingling in feet and hands).

3. HAZARD IDENTIFICATION (Continued)

CHRONIC: Abnormal color perception and pigment changes in the eyes have been reported among persons exposed to 420 -1300 ppm of n-Hexane for five years. Additionally, long-term exposure to low levels of n-Hexane or n-Pentane can affect the nerves in the arms and legs. Effects include numbing or tingling sensation, tiredness, cramps, spasms in legs, difficulty holding objects or walking, loss of appetite and weight loss. Pentane isomers, such as n-Pentane, and Propane can cause sensitization of the heart to epinephrine. Refer to Section 11 (Toxicology Information) for additional information on the components of this gas mixture.

TARGET ORGANS: ACUTE: Respiratory system, blood system, central nervous system, cardiovascular system. CHRONIC: Reproductive system, cardiovascular system.

4. FIRST-AID MEASURES

RESCUERS SHOULD NOT ATTEMPT TO RETRIEVE VICTIMS OF EXPOSURE TO THIS GAS MIXTURE WITHOUT ADEQUATE PERSONAL PROTECTIVE EQUIPMENT. At a minimum, Self-Contained Breathing Apparatus must be worn.

No unusual health effects are anticipated after exposure to this gas mixture, due to the small cylinder size. If any adverse symptom develops after over-exposure to this gas mixture, remove victim(s) to fresh air as quickly as possible. Only trained personnel should administer supplemental oxygen and/or cardio-pulmonary resuscitation if necessary.

Victim(s) who experience any adverse effect after over-exposure to this gas mixture must be taken for medical attention. Rescuers should be taken for medical attention if necessary. Take a copy of the label and the MSDS to physician or other health professional with victim(s).

SKIN EXPOSURE: If irritation of the skin develops after exposure to this gas mixture, immediately begin decontamination with running water. Minimum flushing is for 15 minutes. Remove exposed or contaminated clothing, taking care not to contaminate eyes. Victim must seek immediate medical attention.

EYE EXPOSURE: If irritation of the eye develops after exposure to this gas mixture, open victim's eyes while under gentle running water. Use sufficient force to open eyelids. Have victim "roll" eyes. Minimum flushing is for 15 minutes. Seek medical assistance immediately, preferably an ophthalmologist.

MEDICAL CONDITIONS AGGRAVATED BY EXPOSURE: Pre-existing respiratory conditions may be aggravated by over-exposure to this gas mixture. Carbon Monoxide, a component of this gas mixture, can aggravate some diseases of the cardiovascular system, such as coronary artery disease and angina pectoris. Because of the presence of Hydrogen Sulfide, n-Hexane or n-Pentane in this gas mixture, central nervous system conditions, eye disorders, or skin problems may be aggravated by over-exposure to this gas mixture.

RECOMMENDATIONS TO PHYSICIANS: Treat symptoms and eliminate over-exposure. Hyperbaric oxygen is the most efficient antidote to Carbon Monoxide poisoning, the optimum range being 2-2.5 atm. A special mask, or, preferably, a compression chamber to utilize oxygen at these pressures is required. Avoid administering stimulant drugs. Be observant for initial signs of pulmonary edema in the event of severe inhalation over-exposures.

5. FIRE-FIGHTING MEASURES

FLASH POINT: Not applicable.

AUTOIGNITION TEMPERATURE: Not applicable.

FLAMMABLE LIMITS (in air by volume, %):

Lower (LEL): Not applicable.

Upper (UEL): Not applicable.

FIRE EXTINGUISHING MATERIALS: Non-flammable gas mixture. Use extinguishing media appropriate for surrounding fire.

UNUSUAL FIRE AND EXPLOSION HAZARDS: This gas mixture contains toxic gases, Hydrogen Sulfide and Carbon Monoxide, and presents an extreme health hazard to firefighters. This gas mixture is not flammable; however, containers, when involved in fire, may rupture or burst in the heat of the fire.

Explosion Sensitivity to Mechanical Impact: Not Sensitive.

Explosion Sensitivity to Static Discharge: Not Sensitive.

SPECIAL FIRE-FIGHTING PROCEDURES: Structural firefighters must wear Self-Contained Breathing Apparatus and full protective equipment.

NFPA RATING

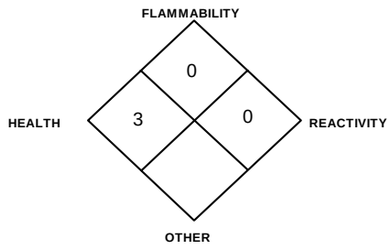

6. ACCIDENTAL RELEASE MEASURES

LEAK RESPONSE: Due to the small size and content of the cylinder, an accidental release of this gas mixture presents significantly less risk of over-exposure to Hydrogen Sulfide and Carbon Monoxide, the toxic components of this gas mixture, and other safety hazards related to the remaining components of this gas mixture, than a similar release from a larger cylinder. However, as with any chemical release, extreme caution must be used during emergency response procedures. In the event of a release in which the atmosphere is unknown, and in which other chemicals are potentially involved, evacuate immediate area. Such releases should be responded to by trained personnel using pre-planned procedures. Proper protective equipment should be used. In case of a leak, clear the affected area, protect people, and respond with trained personnel.

For emergency disposal, secure the cylinder and slowly discharge the gas to the atmosphere in a well-ventilated area or outdoors. Allow the gas mixture to dissipate. If necessary, monitor the surrounding area (and the original area of the release) for Hydrogen Sulfide, Carbon Monoxide, and Oxygen. Hydrogen Sulfide and Carbon Monoxide level must be below exposure level listed in Section 2 (Composition and Information on Ingredients) and Oxygen levels must be above 19.5% before non-emergency personnel are allowed to re-enter area.

If leaking incidentally from the cylinder, contact your supplier.

7. HANDLING and USE

WORK PRACTICES AND HYGIENE PRACTICES: Be aware of any signs of dizziness or fatigue; exposures to fatal concentrations of this gas mixture could occur without any significant warning symptoms, due to olfactory fatigue or oxygen deficiency. Do not attempt to repair, adjust, or in any other way modify cylinders containing a gas mixture with Hydrogen Sulfide or Carbon Monoxide. If there is a malfunction or another type of operational problem, contact nearest distributor immediately. Eye wash stations/safety showers should be near areas where this gas mixture is used or stored. All work operations should be monitored in such a way that emergency personnel can be immediately contacted in the event of a release. All work practices should minimize releases of Hydrogen Sulfide and Carbon Monoxide-containing gas mixtures.

STORAGE AND HANDLING PRACTICES: Cylinders should be firmly secured to prevent falling or being knocked-over. Cylinders must be protected from the environment, and preferably kept at room temperature (approximately 21°C, 70°F). Cylinders should be stored in dry, well-ventilated areas, away from sources of heat, ignition, and direct sunlight. Protect cylinders against physical damage.

Full and empty cylinders should be segregated. Use a first-in, first-out inventory system to prevent full containers from being stored for long periods of time. These cylinders are not refillable. **WARNING! Do not refill DOT 39 cylinders. To do so may cause personal injury or property damage.**

SPECIAL PRECAUTIONS FOR HANDLING GAS CYLINDERS: WARNING! Compressed gases can present significant safety hazards. During cylinder use, use equipment designed for these specific cylinders. Ensure all lines and equipment are rated for proper service pressure.

PROTECTIVE PRACTICES DURING MAINTENANCE OF CONTAMINATED EQUIPMENT: Follow practices indicated in Section 6 (Accidental Release Measures). Make certain that application equipment is locked and tagged-out safely. Always use product in areas where adequate ventilation is provided.

8. EXPOSURE CONTROLS - PERSONAL PROTECTION

VENTILATION AND ENGINEERING CONTROLS: No special ventilation systems or engineering controls are needed under normal circumstances of use. As with all chemicals, use this gas mixture in well-ventilated areas. If this gas mixture is used in a poorly-ventilated area, install automatic monitoring equipment to detect the levels of Oxygen, Hydrogen Sulfide, and Carbon Monoxide.

RESPIRATORY PROTECTION: No special respiratory protection is required under normal circumstances of use. Use supplied air respiratory protection if Carbon Monoxide levels exceed the exposure levels given in Section 2 (Composition and Information on Ingredients) or if oxygen levels are below 19.5%, or if either level is unknown during emergency response to a release of this gas mixture. If respiratory protection is required for emergency response to this gas mixture, follow the requirements of the Federal OSHA Respiratory Protection Standard (29 CFR 1910.134) or equivalent State standards. The following NIOSH respiratory protection recommendations for Hydrogen Sulfide and Carbon Monoxide are provided for further information.

8. EXPOSURE CONTROLS - PERSONAL PROTECTION (Continued)

NIOSH/OSHA RECOMMENDATIONS FOR HYDROGEN SULFIDE CONCENTRATIONS IN AIR:

Up to 100 ppm: Powered air-purifying respirator with cartridge(s) to protect against hydrogen sulfide; or gas mask with canister to protect against hydrogen sulfide; or SAR; or full-facepiece SCBA.

Emergency or Planned Entry into Unknown Concentration or IDLH Conditions: Positive pressure, full-facepiece SCBA; or positive pressure, full-facepiece SAR with an auxiliary positive pressure SCBA.

Escape: Gas mask with canister to protect against hydrogen sulfide; or escape-type SCBA

NOTE: The IDLH concentration for Hydrogen Sulfide is 100 ppm.

NIOSH/OSHA RECOMMENDATIONS FOR CARBON MONOXIDE CONCENTRATIONS IN AIR:

Up to 350 ppm Supplied Air Respirator (SAR)

Up to 875 ppm Supplied Air Respirator (SAR) operated in a continuous flow mode.

Up to 1200 ppm Gas mask with canister to protect against carbon monoxide; or full-facepiece SCBA; or full-facepiece Supplied Air Respirator (SAR).

Emergency or Planned Entry into Unknown Concentration or IDLH Conditions: Positive pressure, full-facepiece SCBA; or positive pressure, full-facepiece Supplied Air Respirator (SAR) with an auxiliary positive pressure SCBA.

Escape: Gas mask with canister to protect against carbon monoxide; or escape-type SCBA.

NOTE: End of Service Life Indicator (ESLI) required for gas masks.

EYE PROTECTION: Safety glasses. If necessary, refer to U.S. OSHA 29 CFR 1910.133 or appropriate Canadian Standards.

HAND PROTECTION: No special protection is needed under normal circumstances of use. If necessary, refer to U.S. OSHA 29 CFR 1910.138 or appropriate Standards of Canada.

BODY PROTECTION: No special protection is needed under normal circumstances of use. If a hazard of injury to the feet exists due to falling objects, rolling objects, where objects may pierce the soles of the feet or where employee's feet may be exposed to electrical hazards, use foot protection, as described in U.S. OSHA 29 CFR 1910.136.

9. PHYSICAL and CHEMICAL PROPERTIES

The following information is for Nitrogen, the main component of this gas mixture.

GAS DENSITY @ 32°F (0°C) and 1 atm: 0.072 lbs/ ft^3 (1.153 kg/m^3)

FREEZING/MELTING POINT @ 10 psig: -210°C (-345.8°F)

SPECIFIC GRAVITY (air = 1) @ 70°F (21.1°C): 0.906

SOLUBILITY IN WATER vol/vol @ 32°F (0°C) and 1 atm: 0.023

EVAPORATION RATE (nBuAc = 1): Not applicable.

ODOR THRESHOLD: Not applicable.

VAPOR PRESSURE @ 70°F (21.1°C) psig: Not applicable.

COEFFICIENT WATER/OIL DISTRIBUTION: Not applicable.

BOILING POINT: -195.8°C (-320.4°F)

pH: Not applicable.

MOLECULAR WEIGHT: 28.01

EXPANSION RATIO: Not applicable.

SPECIFIC VOLUME (ft^3/lb): 13.8

The following information is for the gas mixture.

APPEARANCE AND COLOR: This gas mixture is a colorless gas which has an rotten egg-like odor, due to the presence of Hydrogen Sulfide.

HOW TO DETECT THIS SUBSTANCE (warning properties): Continuous inhalation of low concentrations of Hydrogen Sulfide (a component of this gas mixture) may cause olfactory fatigue, so that there are no distinct warning properties. In terms of leak detection, fittings and joints can be painted with a soap solution to detect leaks, which will be indicated by a bubble formation. Wet lead acetate paper can be used for leak detection. The paper turns black in the presence of Hydrogen Sulfide. Cadmium chloride solutions can also be used. Cadmium solutions will turn yellow upon contact with Hydrogen Sulfide.

10. STABILITY and REACTIVITY

STABILITY: Normally stable in gaseous state.

DECOMPOSITION PRODUCTS: The thermal decomposition products of Propane, n-Hexane, and n-Pentane include carbon oxides. The decomposition products of Hydrogen Sulfide include water and sulfur oxides. The other components of this gas mixture do not decompose, per se, but can react with other compounds in the heat of a fire.

MATERIALS WITH WHICH SUBSTANCE IS INCOMPATIBLE: Titanium will burn in Nitrogen (the main component of this gas mixture). Lithium reacts slowly with Nitrogen at ambient temperatures. Components of this gas mixture (Hydrogen Sulfide, Propane, n-Pentane, n-Hexane) are also incompatible with strong oxidizers (i.e. chlorine, bromine pentafluoride, oxygen, oxygen difluoride, and nitrogen trifluoride). Carbon Monoxide is mildly corrosive to nickel and iron (especially at high temperatures and pressures). Hydrogen Sulfide is corrosive to most metals, because it reacts with these substances to form metal sulfides.

HAZARDOUS POLYMERIZATION: Will not occur.

CONDITIONS TO AVOID: Contact with incompatible materials. Cylinders exposed to high temperatures or direct flame can rupture or burst.

11. TOXICOLOGICAL INFORMATION

TOXICITY DATA: The following toxicology data are available for the components of this gas mixture:

NITROGEN: There are no specific toxicology data for Nitrogen. Nitrogen is a simple asphyxiant, which acts to displace oxygen in the

n-PENTANE:

LD_{50} (intravenous, mouse) = 446 mg/kg.

LC_{50} (inhalation, rat) = 364 g/m^3/4 hours

LCLo (inhalation, mouse) = 325 g/m^3/2 hours

n-HEXANE:

Eye, rabbit = 10 mg/ mild

TCLo (inhalation, rat) = 10,000 ppm/7 hr.

TCLo (inhalation, rat) = 5000 ppm/20 hours; teratogenic effects

LD50 (oral, rat) = 28710 mg/kg

LDLo (intraperitoneal, rat) = 9100 mg/kg

LCLo (inhalation, mouse) = 120,000 mg/kg

LD50 (rat, oral): 28,710 mg/kg

ACUTE INHALATION (mouse): 30,000 ppm, narcosis within 30 to 60 minutes; 35,000-40,000 ppm, convulsions and death.

DERMAL (rabbit): 2 to 5 ml/kg for 4 hours resulted in restlessness and discoordination,; death occurred at 5 ml/kg.

HYDROGEN SULFIDE:

LCLo (inhalation, human) = 600 ppm/30 minutes

LDLO (inhalation, man) = 5.7 mg/kg; central nervous system, pulmonary effects

n-HEXANE (continued):

CHRONIC INHALATION (rat): 400-600 ppm, 5 days/week, peripheral neuropathy in 45 days; 850 ppm for 143 days, loss of weight and degeneration of the sciatic nerve. (mouse): 250 ppm, peripheral neuropathy within 7 months; no effects at 100 ppm.

PROPANE:

Long-Term Inhalation: No toxicity or abnormalities were observed when monkeys were exposed to approximately 750 ppm for 90 days. Similar results were obtained when monkeys were exposed to an aerosol spray containing 65% propane and isobutane.

CARBON MONOXIDE:

TCLo (inhalation, mouse) = 65 ppm/24 hours (7-18 preg): rep. effects

TCLo (inhalation, mouse) = 8 pph/1 hour (female 8D post): ter. effects

HYDROGEN SULFIDE (continued):

LCLo (inhalation, human) = 800 ppm/5 minutes

LC_{50} (inhalation, rat) = 444 ppm

CARBON MONOXIDE (continued):

TCLo (inhalation, human) = 600 mg/m^3/10 minutes

LCLo (inhalation, man) = 4000 ppm/30 minutes

TCLo (inhalation, man) = 650 ppm/45 minutes: central nervous system and blood system effects.

LCLo (inhalation, human) = 5000 ppm/5 minutes

LCLo (inhalation, dog) = 4000 ppm/46 minutes

LCLo (inhalation, rabbit) = 4000 ppm

LC_{50} (inhalation, rat) = 1811 ppm/4 hours

LC_{50} (inhalation, guinea pig) = 2450 ppm/4 hours

LC_{50} (inhalation, guinea pig) = 5718 ppm/4 hours

LCLo (inhalation, mammal) = 5000 ppm/5 minutes

LD_{50} (inhalation, wild bird) = 1334 ppm

HYDROGEN SULFIDE (continued):

LC_{50} (inhalation, mouse) = 673 ppm/1 hour

LCLo (inhalation, mammal) = 800 ppm/5 minutes

SUSPECTED CANCER AGENT: The components of this gas mixture are not found on the following lists: FEDERAL OSHA Z LIST, NTP, CAL/OSHA, and IARC; therefore, they are not considered to be, nor suspected to be, cancer-causing agents by these agencies.

IRRITANCY OF PRODUCT: The Hydrogen Sulfide component of this gas mixture, is irritating to the eyes, and may be irritating to the skin.

SENSITIZATION OF PRODUCT: The components of this gas mixture are not known to be skin or respiratory sensitizers. Pentane isomers (i.e. n-Pentane) and Propane can cause cardiac sensitization to epinephrine.

REPRODUCTIVE TOXICITY INFORMATION: Listed below is information concerning the effects of this gas mixture on the human reproductive system.

Mutagenicity: No mutagenicity effects have been described for the components of this gas mixture.

Embryotoxicity: This gas mixture contains components that may cause embryotoxic effects in humans; however, due to the small total amount of the components, embryotoxic effects are not expected to occur.

Teratogenicity: This gas mixture is not expected to cause teratogenic effects in humans due to the small cylinder size and small total amount of all components. The Carbon Monoxide component of this gas mixture which exists up to 1%, can cause teratogenic effects in humans. Severe

11. TOXICOLOGICAL INFORMATION (continued)

exposure to Carbon Monoxide during pregnancy has caused adverse effects and the death of the fetus. In general, maternal symptoms are an indicator of the potential risk to the fetus since Carbon Monoxide is toxic to the mother before it is toxic to the fetus.

Reproductive Toxicity: The components of this gas mixture are not expected to cause adverse reproductive effects in humans.

A mutagen is a chemical which causes permanent changes to genetic material (DNA) such that the changes will propagate through generation lines. An embryotoxin is a chemical which causes damage to a developing embryo (i.e. within the first eight weeks of pregnancy in humans), but the damage does not propagate across generational lines. A teratogen is a chemical which causes damage to a developing fetus, but the damage does not propagate across generational lines. A reproductive toxin is any substance which interferes in any way with the reproductive process.

BIOLOGICAL EXPOSURE INDICES (BEIs): Biological Exposure Indices (BEIs) have been determined for the components of this gas mixture, as follows:

CHEMICAL DETERMINANT	SAMPLING TIME	BEI
CARBON MONOXIDE • Carboxyhemoglobin in blood • Carbon monoxide in end-exhaled air	 • End of shift • End of shift	 • 3.5% of hemoglobin • 20 ppm
n-HEXANE • 2,5-Hexanedione in urine • n-Hexane in end-exhaled air	• End of shift	• 5 mg/g creatinine

12. ECOLOGICAL INFORMATION

ENVIRONMENTAL STABILITY: The gas will be dissipated rapidly in well-ventilated areas. The following environmental data are applicable to the components of this gas mixture.

OXYGEN: Water Solubility = 1 volume Oxygen/32 volumes water at 20°C. Log K_{ow} = -0.65

PROPANE: Log K_{ow} = 2.38. Water Solubility = 62.4 ppm, 25°C. Propane is readily degraded by soil bacteria.

PENTANE: Log K_{ow} = 3.39. Water Solubility = 38.5 mg/L. LOG BCF (n-pentane) = calculated, 1.90 and 2.35, respectively. Photolysis, hydrolysis, and bioconcentration are not anticipated to be important fate processes. Biodegradation and soil adsorption are anticipated to be more important processes for this compound.

n-HEXANE: Log K_{ow} = 3.90-4.11. Water Solubility = 9.5 mg/L. Estimated Bioconcentration Factor =2.24 and 2.89. Bioconcentration in aquatic organisms is low. Hexane is volatile. Rapid volatilization from water and soil is anticipated for this compound. Hexane will float in slick on surface of the water

HYDROGEN SULFIDE: Water Solubility = 1 g/242 mL at 20°C.

CARBON MONOXIDE: Water solubility = 3.3 ml/100 cc at 0 °C, 2.3 ml at 20°C.

NITROGEN: Water Solubility = 2.4 volumes Nitrogen/100 volumes water at 0°C; 1.6 volumes Nitrogen/100 volumes water at 20°C.

EFFECT OF MATERIAL ON PLANTS or ANIMALS: No evidence is currently available on this gas mixture's effects on plant and animal life. The Hydrogen Sulfide and Carbon Monoxide components of this gas mixture, can be deadly to exposed animal life, producing symptoms similar to those experienced by humans. This gas mixture may also be harmful to plant life.

EFFECT OF CHEMICAL ON AQUATIC LIFE: No evidence is currently available on the effects of this gas effects on aquatic life. The presence of more than a trace of Carbon Monoxide is a hazard to fish. The following aquatic toxicity data are available for the Hydrogen Sulfide component of this gas mixture.

TLm (Asellussp) = 0.111 mg/L/96 hour
TLm (Cranfgonyx sp) =1.07 mg/L/96 hour
TLm (Gammarrus) = 0.84 mg/L/96 hour
LC_{50} (fly inhalation) = 380 mg/m^3/960 minutes
LC_{50} (fly inhalation) = 1500 mg/m^3/7 minutes
TLm (Lepomis macrochirus, bluegill sunfish) = 0.0478 mg/L/96 hour
TLm (Lepomis macrochirus, bluegill sunfish) = 0.0448 mg/L/96 hour at 21-22 °C
TLm (Pimephlaes promelas, fathead minnow) = 0.0071-0.55 mg/L/96 hour
TLm (Salvenilis foninalis, brook trout) = 0.0216-0.038 mg/L/96 hour at 8-12.5 °C

13. DISPOSAL CONSIDERATIONS

PREPARING WASTES FOR DISPOSAL PREPARING WASTES FOR DISPOSAL: Waste disposal must be in accordance with appropriate Federal, State, and local regulations. Cylinders with undesired residual product may be safely vented outdoors with the proper regulator. For further information, refer to Section 16 (Other Information).

14. TRANSPORTATION INFORMATION

THIS GAS MIXTURE IS HAZARDOUS AS DEFINED BY 49 CFR 172.101 BY THE U.S. DEPARTMENT OF TRANSPORTATION.

PROPER SHIPPING NAME: Compressed gases, n.o.s. (*Oxygen, Nitrogen)*or the gas component with the next highest concentration next to Nitrogen.

HAZARD CLASS NUMBER and DESCRIPTION: 2.2 (Non-Flammable Gas)

UN IDENTIFICATION NUMBER: UN 1956

PACKING GROUP: Not Applicable

DOT LABEL(S) REQUIRED: Class 2.2 (Non-Flammable Gas)

NORTH AMERICAN EMERGENCY RESPONSE GUIDEBOOK NUMBER (2000): 126

MARINE POLLUTANT: The components of this gas mixture are not classified by the DOT as Marine Pollutants (as defined by 49 CFR 172.101, Appendix B).

SPECIAL SHIPPING INFORMATION: Cylinders should be transported in a secure position, in a well-ventilated vehicle. The transportation of compressed gas cylinders in automobiles or in closed-body vehicles can present serious safety hazards. If transporting these cylinders in vehicles, ensure these cylinders are not exposed to extremely high temperatures (as may occur in an enclosed vehicle on a hot day). Additionally, the vehicle should be well-ventilated during transportation.

Note: DOT 39 Cylinders ship in a strong outer carton (overpack). Pertinent shipping information goes on the outside of the overpack. DOT 39 Cylinders do not have transportation information on the cylinder itself.

TRANSPORT CANADA TRANSPORTATION OF DANGEROUS GOODS REGULATIONS: This gas is considered as Dangerous Goods, per regulations of Transport Canada.

PROPER SHIPPING NAME: Compressed gases, n.o.s. (*Oxygen, Nitrogen)*or the gas component with the next highest concentration next to Nitrogen.

HAZARD CLASS NUMBER and DESCRIPTION: 2.2 (Non-Flammable Gas)

UN IDENTIFICATION NUMBER: UN 1956

PACKING GROUP: Not Applicable

HAZARD LABEL: Class 2.2 (Non-Flammable Gas)

SPECIAL PROVISIONS: None

EXPLOSIVE LIMIT AND LIMITED QUANTITY INDEX: 0.12

ERAP INDEX: None

PASSENGER CARRYING SHIP INDEX: None

PASSENGER CARRYING ROAD VEHICLE OR PASSENGER CARRYING RAILWAY VEHICLE INDEX: 75

NORTH AMERICAN EMERGENCY RESPONSE GUIDEBOOK NUMBER (2000): 126

NOTE: Shipment of compressed gas cylinders via Public Passenger Road Vehicle is a violation of Canadian law (Transport Canada Transportation of Dangerous Goods Act, 1992).

15. REGULATORY INFORMATION

ADDITIONAL U.S. REGULATIONS:

U.S. SARA REPORTING REQUIREMENTS: This gas is not subject to the reporting requirements of Sections 302, 304 and 313 of Title III of the Superfund Amendments and Reauthorization Act., as follows:

COMPONENT	SARA 302 (40 CFR 355, Appendix A)	SARA 304 (40 CFR Table 302.4)	SARA 313 (40 CFR 372.65)
n-Hexane	NO	YES	YES
Hydrogen Sulfide	YES	YES	YES

15. REGULATORY INFORMATION (Continued)

U.S. SARA THRESHOLD PLANNING QUANTITY: Section 302 EHS TPQ = Hydrogen Sulfide = 500 lbs (227 kg);
U.S. TSCA INVENTORY STATUS: The components of this gas mixture are listed on the TSCA Inventory.
U.S. CERCLA REPORTABLE QUANTITY (RQ): Hexane = 5000 lb (2270 kg); Hydrogen Sulfide = 100 lbs (45.4 lb)
OTHER U.S. FEDERAL REGULATIONS:

- Hydrogen Sulfide, Carbon Monoxide, Propane, n-Pentane and n-Hexane are subject to the reporting requirements of CFR 29 1910.1000.
- Hydrogen Sulfide, Propane and n-Pentane are subject to the reporting requirements of Section 112(r) of the Clean Air Act. The Threshold Quantity for each of these gases is 10,000 pounds and so this mixture will not be affected by the regulation.
- Depending on specific operations involving the use of this gas mixture, the regulations of the Process Safety Management of Highly Hazardous Chemicals may be applicable (29 CFR 1910.119). Hydrogen Sulfide is listed in Appendix A of this regulation. The Threshold Quantity for Hydrogen Sulfide under this regulation is 1500 lbs.
- This gas mixture does not contain any Class I or Class II ozone depleting chemicals (40 CFR part 82).
- Nitrogen, Oxygen and n-Hexane are not listed Regulated Substances, per 40 CFR, Part 68, of the Risk Management for Chemical Releases. Hydrogen Sulfide is listed under this regulation in Table 1 as a Regulated Substance (Toxic Substance), in quantities of 10,000 lbs (4,553 kg) or greater. Carbon Monoxide, Propane and n-Pentane are listed under this regulation in Table 3, as Regulated Substances (Flammable), in quantities of 10,000 lbs (4,553 kg) or greater, and so this mixture will not be affected by the regulation.

U.S. STATE REGULATORY INFORMATION: The components of this gas mixture are covered under the following specific State regulations:

Alaska - Designated Toxic and Hazardous Substances: Carbon Monoxide, Propane, n-Pentane, n-Hexane, Hydrogen Sulfide.
California - Permissible Exposure Limits for Chemical Contaminants: Carbon Monoxide, Nitrogen, Propane, n-Pentane, n-Hexane, Hydrogen Sulfide.
Florida - Substance List: Oxygen, Carbon Monoxide, n-Pentane, n-Hexane, Hydrogen Sulfide.
Illinois - Toxic Substance List: Carbon Monoxide, Propane, n-Pentane, n-Hexane, Hydrogen Sulfide.
Kansas - Section 302/313 List: No.
Massachusetts - Substance List: Oxygen, Carbon Monoxide, Propane, n-Pentane, n-Hexane, Hydrogen Sulfide.
Michigan - Critical Materials Register: No.
Minnesota - List of Hazardous Substances: Carbon Monoxide, Propane, n-Pentane, n-Hexane, Hydrogen Sulfide.
Missouri - Employer Information/Toxic Substance List t: n-Pentane, n-Hexane, Propane, Hydrogen Sulfide.
New Jersey - Right to Know Hazardous Substance List: Oxygen, Carbon Monoxide, Nitrogen, Propane, n-Pentane, n-Hexane.
North Dakota - List of Hazardous Chemicals, Reportable Quantities: Hydrogen Sulfide.
Pennsylvania - Hazardous Substance List: Oxygen, Carbon Monoxide, Nitrogen, Propane, n-Pentane, n-Hexane, Hydrogen Sulfide.
Rhode Island - Hazardous Substance List: Oxygen, Carbon Monoxide, Nitrogen, Propane, n-Pentane, n-Hexane, Hydrogen Sulfide.
Texas - Hazardous Substance List: n-Pentane, n-Hexane, Propane, Hydrogen Sulfide.
West Virginia - Hazardous Substance List: n-Pentane, n-Hexane, Propane, Hydrogen Sulfide.
Wisconsin - Toxic and Hazardous Substances: n-Pentane, n-Hexane, Propane, Hydrogen Sulfide

CALIFORNIA SAFE DRINKING WATER AND TOXIC ENFORCEMENT ACT (PROPOSITION 65): The Carbon Monoxide component of this gas mixture is on the California Proposition 65 lists as a chemical known to the State of California to cause birth defects or other reproductive harm.
ADDITIONAL CANADIAN REGULATIONS:

CANADIAN DSL/NDSL INVENTORY STATUS: The components of this gas mixture are on the Canadian DSL Inventory.
CANADIAN ENVIRONMENTAL PROTECTION ACT (CEPA) PRIORITIES SUBSTANCES LISTS: The components of this gas mixture are not on the CEPA Priorities Substances List.
CANADIAN WHMIS CLASSIFICATION: This gas mixture is categorized as a Controlled Product, Hazard Classes A and D2A, as per the Controlled Product Regulations.

16. OTHER INFORMATION

INFORMATION ABOUT DOT-39 NRC (Non-Refillable Cylinder) PRODUCTS

DOT 39 cylinders ship as hazardous materials when full. Once the cylinders are relieved of pressure (empty) they are not considered hazardous material or waste. Residual gas in this type of cylinder is not an issue because toxic gas mixtures are prohibited. Calibration gas mixtures typically packaged in these cylinders are Nonflammable n.o.s., UN 1956. A small percentage of calibration gases packaged in DOT 39 cylinders are flammable or oxidizing gas mixtures.

For disposal of used DOT-39 cylinders, it is acceptable to place them in a landfill if local laws permit. Their disposal is no different than that employed with other DOT containers such as spray paint cans, household aerosols, or disposable cylinders of propane (for camping, torch etc.). When feasible, we recommended recycling for scrap metal content. CALGAZ will do this for any customer that wishes to return cylinders to us prepaid. All that is required is a phone call to make arrangements so we may anticipate arrival. Scrapping cylinders involves some preparation before the metal dealer may accept them. We perform this operation as a service to valued customers who want to participate.

MIXTURES: When two or more gases or liquefied gases are mixed, their hazardous properties may combine to create additional, unexpected hazards. Obtain and evaluate the safety information for each component before you produce the mixture. Consult an Industrial Hygienist or other trained person when you make your safety evaluation of the end product. Remember, gases and liquids have properties which can cause serious injury or death.

Further information about the handling of compressed gases can be found in the following pamphlets published by: Compressed Gas Association Inc. (CGA), 1725 Jefferson Davis Highway, Suite 1004, Arlington, VA 22202-4102. Telephone: (703) 412-0900.

P-1 *"Safe Handling of Compressed Gases in Containers"*
AV-1 *"Safe Handling and Storage of Compressed Gases"*
"Handbook of Compressed Gases"

PREPARED BY: CHEMICAL SAFETY ASSOCIATES, Inc.
PO Box 3519, La Mesa, CA 91944-3519
619/670-0609

Fax on Demand: 1-800/231-1366

AIR LIQUIDE™

This Material Safety Data Sheet is offered pursuant to OSHA's Hazard Communication Standard, 29 CFR, 1910.1200. Other government regulations must be reviewed for applicability to this gas mixture. To the best of CALGAZ knowledge, the information contained herein is reliable and accurate as of this date; however, accuracy, suitability or completeness are not guaranteed and no warranties of any type, either express or implied, are provided. The information contained herein relates only to this specific product. If this gas mixture is combined with other materials, all component properties must be considered. Data may be changed from time to time. Be sure to consult the latest edition.

APPENDIX C

COVID-19 Interim Health and Safety Guidance

COVID-19 INTERIM HEALTH AND SAFETY GUIDANCE

CORPORATE HEALTH AND SAFETY MANAGER	:	**Brian Hobbs, CIH, CSP**
EFFECTIVE DATE	:	**03/2020**
REVISION DATE	:	**10/08/2020**
REVISION NUMBER	:	**5**

TABLE OF CONTENTS

1. PURPOSE 1

2. SCOPE AND APPLICABILITY 1

3. BACKGROUND 1

4. TRAINING REQUIREMENTS 2

5. EXPOSURE RISK POTENTIAL 2

6. COVID-19 HEALTH SCREENING 4
   6.1. Roux Employees 4
   6.2. Subcontractors 5

7. SELF-ISOLATION & QUARANTINE 5
   7.1. Self-Isolation 5
   7.2. Quarantine 6
      7.2.1. Close Contact Quarantine 6
      7.2.2. Travel Related Quarantine 6

8. WORKPLACE CONTROLS 6

9. INFECTION PREVENTION MEASURES 7

10. CLOTH FACE COVERINGS 9

11. HOTEL SELECTION PROCESS AND OVERNIGHT/REMOTE WORK 9

12. TRANSPORTATION-RENTAL CARS AND ROUX-OWNED VEHICLES 10

APPENDICES

A. Subcontractor Work Crew COVID-19 Daily Health Attestation

B. Job Safety Analysis-Working in Areas Affected by COVID-19

C. How to Remove Gloves

1. PURPOSE

This guidance has been implemented to establish work practices, administrative procedures, and engineering controls to minimize potential exposure to SARS-CoV-2, the virus that causes COVID-19. The following guidance has been developed based on local, state and federal recommendations/requirements regarding COVID-19. The purpose of this document is to supplement existing site-specific Health and Safety Plans (HASPs) and provide interim health and safety guidance to minimize potential exposure to SARS-CoV-2. Should additional scientific information or regulatory information change, this document shall be updated accordingly.

2. SCOPE AND APPLICABILITY

This guidance covers all Roux employees and the subcontractors that Roux oversees. Site specific HASPs shall be developed to incorporate elements of mitigative measures against COVID-19 exposure. If work cannot be carried out in compliance with this guidance, the project shall be further evaluated by the Project Principal (PP), Office Manager (OM), and Corporate Health and Safety Manager (CHSM) prior to work authorization.

Roux subcontractors are required to review, comply with, and implement Roux's COVID-19 Interim Health and Safety Guidance while on site. Subcontractors may implement additional preventative measures as they see fit. All work shall be conducted in a manner consistent with the federal, state, and local guidance as it relates to COVID-19.

3. BACKGROUND

What is COVID-19?

COVID-19 is a respiratory illness that can spread from person to person. The virus that causes COVID-19 is a novel coronavirus that was first identified during an investigation into an outbreak in Wuhan, China. This virus continues to spread internationally and within the United States. There is currently no vaccine to prevent COVID-19.

What are the symptoms of COVID-19?

Reported illnesses have ranged from mild symptoms to severe illness and death for confirmed COVID-19 cases. Symptoms may appear 2 to 14 days following exposure to the virus. People with these symptoms or combinations of symptoms may have COVID-19:

- Fever or chills
- Cough
- Shortness of breath or difficulty breathing
- Fatigue
- Muscle or body aches
- Headache
- New loss of taste or smell
- Sore throat
- Congestion or runny nose
- Nausea or vomiting
- Diarrhea

This list is not all possible symptoms. The CDC will continue to update this list as they learn more about the virus. For an updated symptom list please reference the following link for CDC Symptoms of Coronavirus.

If someone develops emergency warning signs for COVID-19, they should be instructed to get medical attention immediately. Emergency warning signs can include those listed below; however, this list is not all inclusive. Please consult your medical provider for any other symptoms that are severe or concerning.

- Trouble breathing
- Persistent pain or pressure in the chest
- New confusion
- Inability to wake or stay awake
- Bluish lips or face

How does COVID-19 spread?[1]

SARS-COV-2 spreads very easily from person to person during close contact.

Individuals who are within close contact (within 6 feet) of a person with COVID-19 or have direct contact with that person are at greatest risk of infection.

- When people with COVID-19 cough, sneeze, sing, talk, or breathe they produce respiratory droplets. These droplets can range in size from larger droplets (some of which are visible) to smaller droplets. Small droplets can also form particles when they dry very quickly in the airstream.
- Infections occur mainly through exposure to respiratory droplets when a person is in close contact with someone who has COVID-19.
- Respiratory droplets cause infection when they are inhaled or deposited on mucous membranes, such as those that line the inside of the nose and mouth.
- As the respiratory droplets travel further from the person with COVID-19, the concentration of these droplets decreases. Larger droplets fall out of the air due to gravity. Smaller droplets and particles spread apart in the air.
- With passing time, the amount of infectious virus in respiratory droplets also decreases.

SARS-CoV-2 can sometimes spread by airborne transmission under certain circumstances.

Some infections can be spread by exposure to virus in small droplets and particles that can linger in the air for minutes to hours. These viruses may be able to infect people who are further than 6 feet away from the person who is infected or after that person has left the space. This kind of spread is referred to as **airborne transmission** and is an important way that infections like tuberculosis, measles, and chicken pox are spread.

- There is evidence that under certain conditions, people with COVID-19 seem to have infected others who were more than 6 feet away. These transmissions occurred within enclosed spaces that had inadequate ventilation. Sometimes the infected person was breathing heavily, for example while singing or exercising.
    - Under these circumstances, scientists believe the amount of infectious smaller droplet and particles produced by the people with COVID-19 became concentrated enough to spread the virus to other people. The people who were infected were in the same space during the same time or shortly after the person with COVID-19 had left.
- Available data indicate it is much more common for the virus that causes COVID-19 to spread through close contact with a person who has COVID-19 than through airborne transmission.[2]

Spread from contact with contaminated surfaces or objects is less common.

Respiratory droplets can also land on surfaces and objects. It is possible that a person could get COVID-19 by touching a surface or object that has the virus on it and then touching their own mouth, nose, or eyes. Spread from touching surfaces is not thought to be a common way that COVID-19 spreads.

4. TRAINING REQUIREMENTS

All employees with potential exposure to COVID-19 shall be provided training that incorporates COVID-19 exposure mitigation strategies, such as implementation of proper social distancing, personal hygiene (e.g., handwashing), as well as disinfection procedures, as outlined by CDC guidelines.

5. EXPOSURE RISK POTENTIAL

Worker risk of occupational exposure to COVID-19 can vary from very high, high, medium, or lower (caution) risk. This level of exposure is dependent on several factors, which can include industry type; need for contact within

1 How COVID-19 Spreads https://www.cdc.gov/coronavirus/2019-ncov/prevent-getting-sick/how-covid-spreads.html#edn1

2 Scientific Brief: SARS-CoV-2 and Potential Airborne Transmission | CDC https://www.cdc.gov/coronavirus/2019-ncov/more/scientific-brief-sars-cov-2.html

6 feet of people known to be or suspected of being infected with COVID-19; density of work environment; and industrial setting (i.e., healthcare building, occupied interior work area, minimal ventilation).

Provided below is background risk level information taken from the U.S. Department of Labor Occupational Safety and Health Administration Guidance on preparing workplaces for COVID-19. Risk evaluations for each project shall be conducted by the PP and OM in consultation with the CHSM to ensure Roux employees and subcontractors remain within the lower exposure (caution) category. If it is identified there is a medium exposure risk or higher, further evaluation and mitigative measures shall be evaluated to reduce overall exposure risk prior to work authorization.

Very High Exposure Risk (Activities not conducted by Roux)

Very high exposure risk includes occupations/work activities with high potential for exposure to known or suspected sources of COVID-19 during specific medical, postmortem, or laboratory procedures. This can include but is not limited to:

- Healthcare workers (e.g., doctors, nurses, dentists, paramedics, emergency medical technicians) performing aerosol-generating procedures (e.g., intubation, cough induction procedures, bronchoscopies, some dental procedures and exams, or invasive specimen collection) on known or suspected COVID-19 patients.
- Healthcare or laboratory personnel collecting or handling specimens from known or suspected COVID-19 patients (e.g., manipulating cultures from known or suspected COVID-19 patients).
- Morgue workers performing autopsies, which generally involve aerosol-generating procedures on the bodies of people who are known to have, or suspected of having, COVID-19 at the time of their death.

High Exposure Risk (Activities not conducted by Roux)

High exposure risk occupations/work activities include exposure to known or suspected COVID-19 positive individuals. This can include but not limited to:

- Healthcare delivery and support staff (e.g., doctors, nurses, and other hospital staff who must enter patients' rooms) exposed to known or suspected COVID-19 patients. (Note: when such workers perform aerosol-generating procedures, their exposure risk level becomes very high.)
- Medical transport workers (e.g., ambulance vehicle operators) moving known or suspected COVID-19 patients in enclosed vehicles.
- Mortuary workers involved in preparing (e.g., for burial or cremation) the bodies of people who are known to have, or suspected of having, COVID-19 at the time of their death.

Medium Exposure Risk

Medium exposure risk occupations/work activities include those that require frequent and/or close contact with (i.e., within 6 feet of) people who may be infected with COVID-19, but who are not known or suspected to be COVID-19 positive. For most of our worksites, it is assumed there is on-going community transmission for COVID-19. Therefore, workers who work at sites and may have contact with the general public, other contractors, high-population-density work environments (i.e., greater than 10 people) fall within medium exposure risk group category. This can include, but is not limited to, sampling events that require two or more workers to collect and log samples in close contact or work occurring in an interior space with limited ventilation and several workers present.

Lower Exposure Risk (Caution)

Lower exposure risk (caution) occupations/work activities are those that do not require contact with people known to be or suspected of being COVID-19 positive. During these activities, there is limited contact (i.e., within 6 feet of) the general public or other workers. Workers in this category have minimal occupational contact with the public and other coworkers. This can include construction oversight that does not require close contact as well as sampling or gauging events performed by one worker.

6. COVID-19 HEALTH SCREENING

6.1. Roux Employees

All Roux employees are required to self-attest to a COVID-19 Daily Health Questionnaire which is to be completed at home through a mobile application on scheduled workdays. The purpose of this program is to ensure business continuity as well as mitigate any potential exposure to our employees and others if it is determined employees are at-risk for contracting COVID-19. As part of this self-attestation, all employees are required to take their temperatures daily at home to confirm they do not have a fever (≥ 100.4). Employees who answer yes to any of these questions are instructed to contact their Office Manager and/or Department Head immediately and should not enter the office or go to a field site. Information shall be used to determine appropriate internal response in consultation with the Human Resources Director and Corporate Health and Safety Manager.

Below, you will find our COVID-19 Daily Health Questionnaire that all Roux employees are required to self-attest to **every scheduled workday by 9:30 am.** If employees do not promptly fill out the questionnaire by the time listed above, there will be additional follow up by HR, H&S, and/or OMs.

According to the U.S. Centers for Disease Control and Prevention & the World Health Organization, COVID-19 Symptoms include:

- *Fever (≥100. 4°F) or chills*
- *Cough*
- *Shortness of breath or difficulty breathing*
- *Fatigue*
- *Muscle or body aches*
- *Headache*
- *New loss of taste or smell*
- *Sore throat*
- *Congestion or runny nose*
- *Nausea or vomiting*
- *Diarrhea*

Have you experienced any of the COVID-19 related symptoms noted above in the last 14 days? Please Note: We do not expect employees to answer "yes" to the symptoms question if these are symptoms you normally experience due to another condition or medication.

- *Yes*
- *No*

Have you been in close contact with someone who is suspected or confirmed to have COVID-19 or who is under investigation for COVID-19 within the last 14 days? *Close contact is defined as someone who was within 6 feet of an infected person for at least 15 minutes or coming into direct contact with secretions (e.g., sharing utensils, being coughed on) from an infected person.*

- *Yes*
- *No*

Have you traveled outside of the country, been on a cruise ship and/or traveled to areas within the United States which have state mandated travel restrictions in the last 14 days?

- *Yes*
- *No*

Have you tested positive for COVID-19 within the last 14 days?

- *Yes*
- *No*

6.2. Subcontractors

In an effort to mitigate the risk of transmission of COVID-19, Subcontractors who shall perform work on-site are required to attest to the fitness of their work crew on a daily basis. This requires each worker to self-assess by asking themselves the four questions listed in the section above and also contained within the Roux Subcontractor Work Crew COVID-19 Daily Health Attestation. If any crew member answers "yes" to any of the questions, that worker is not to report to the field site and should seek proper medical advice, in accordance with local, state and federal guidelines.

On a daily basis, the subcontractor supervisor must provide the Subcontractor Work Crew COVID-19 Daily Health Attestation complete with the names of all work crew fit to be on the site for that day (i.e., who have answered "no" to all questions on the self-assessment) to Roux's Project Manager. The Subcontractor must notify Roux if there have been any "yes" responses daily. Subcontractors shall not be required to provide the name or any other personal information of any employee who has answered "yes" to any of the self-assessment questions, however, the subcontractor should provide the date and times that employee has been onsite in the prior 14 days. Records shall be maintained within the project files indicating health screening has been performed, records shall be retained for not less than 14 days following the date of submission. The Roux Subcontractor Work Crew COVID-19 Daily Health Check Attestation can be found within Appendix A.

7. SELF-ISOLATION & QUARANTINE

7.1. Self-Isolation

What if I am asked to self-isolate at home and when can I return from home isolation?

Depending on the situation, if you are COVID-19 positive or suspected to have COVID-19, employees may be required to self-isolate in their homes, as per CDC or local health department guidelines. As per CDC guidance, return from isolation has been broken out into two categories. The first includes confirmed or suspected COVID-19 individuals exhibiting symptoms, and the second includes those who have not had COVID-19 symptoms (i.e., asymptomatic), but tested positive and are under self-isolation. Both categories, along with strategies to return from home isolation, are outlined below.

People with COVID-19 under home isolation:

Accumulating evidence supports ending isolation and precautions for persons with COVID-19 using a symptom-based strategy. Specifically, researchers have reported that people with mild to moderate COVID-19 remain infectious no longer than 10 days after their symptoms began, and those with more severe illness or those who are severely immunocompromised remain infectious no longer than 20 days after their symptoms began. Therefore, CDC has updated the recommendations for discontinuing home isolation as follows:

1. **Persons with COVID-19 who have symptoms** and were directed to care for themselves at home may discontinue isolation under the following conditions:
   a. At least 10 days* have passed since symptom onset;
   b. At least 24 hours have passed since resolution of fever without the use of fever-reducing medications; and
   c. Other symptoms have improved.

* *A limited number of persons with severe illness may produce replication-competent virus beyond 10 days, which may warrant extending the duration of isolation for up to 20 days after symptom onset. Consultation with your healthcare provider will be warranted in such cases of severe illness.*

2. **Persons infected with SARS-CoV-2 who never develop COVID-19 symptoms** may discontinue isolation and other precautions 10 days after the date of their first positive RT-PCR test for SARS-CoV-2 RNA.

7.2. Quarantine

Employees may be required to self-quarantine due to potential exposure with a suspected and/or confirmed COVID-19 positive individual as well as recent travel as per local/state guidelines. People in quarantine should stay home, separate themselves from others, monitor their health, and follow directions from their state or local health department. If Roux employees meet the criteria to self-quarantine based on potential exposure/travel, they are required to self-quarantine for 14 days regardless of local/state exemptions. Even if you test negative for COVID-19 or feel healthy, symptoms may still appear 2 to 14 days after exposure to the virus.

7.2.1. Close Contact Quarantine

Employees who have come into close contact with someone who has COVID-19 are required to self-quarantine for 14 days following their last contact with the COVID-19 positive person. Close contact can be defined as being within 6 feet of someone who has COVID-19 for a total of 15 minutes or more, providing care at home to someone who is sick with COVID-19, having direct physical contact with COVID-19 individual, sharing utensils with COVID-19 individual, and being sneezed/coughed on by someone with COVID-19.

7.2.2. Travel Related Quarantine

All travel out of state must be communicated with the OM and/or Department Head prior to departure. Please note, some state/local entities require submissions of traveler health forms. It is expected all Roux employees will comply with such state/local travel requirements. All employees returning from international and/or cruise ship travel must quarantine for 14 days from the time they have returned home.

Personal Travel

Employees who will be traveling out of state are responsible for checking the local/state quarantine guidance for the regions they are traveling from and to in advance of travel and notifying their OM prior to traveling in order to evaluate the impact on the business. Based on state/local guidelines you may be required to quarantine for 14 days from the time you have returned home.

Work-Related Travel

The Project Team (i.e., PM & PP) and field staff who will be traveling are responsible for checking the local/state quarantine guidance for the regions they are traveling from and to in advance of travel and notifying their OM prior to traveling in order to evaluate the impact to the business. Additionally, health and safety considerations shall be reviewed by the OM in consultation with the CHSM regarding logistics and overnight accommodations. Based on state/local guidelines, you may be required to quarantine for 14 days from the time you have returned home.

8. WORKPLACE CONTROLS

During the project planning phase, worksite evaluations shall be carried out by the PP and OM in consultation with the CHSM to determine risk exposure levels for work activities. If it is determined there is a medium exposure risk level or higher, additional workplace controls shall be evaluated and implemented as required in addition to the basic infection prevention measures outlined below in Section 8. Additional workplace controls can include engineering controls (i.e., ventilation, physical barriers), administrative controls (i.e., minimizing contact between workers, rotating shifts, site specific training), and additional personal protective equipment (i.e., respiratory protection). If exposure risk cannot be mitigated, potential project postponement may be necessary at the discretion of the OM in consultation with the CHSM.

A Job Safety Analysis (JSA) has been developed and is provided in Appendix B, which summarizes and applies concepts within this guidance including the infection prevention measures listed below. This JSA shall be required for all field work in areas where there is community-based transmission of COVID-19.

9. INFECTION PREVENTION MEASURES

The following is basic infection prevention and personal hygiene practices which shall be implemented for all Roux field activities as well as in the office setting.

- ***Personal Hygiene***
  - Wash your hands often with soap and water for at least 20 seconds.
    - If soap and water are not available, use an alcohol-based sanitizer that contains at least 60% ethanol or 70% isopropanol.
    - Key times to wash your hands include after blowing your nose, coughing or sneezing, after using the restroom, and before eating or preparing food.
  - Do not touch your eyes, face, nose and mouth with unwashed hands.
  - Cover your mouth and nose with a tissue when you cough or sneeze or use the inside of your elbow.
  - Throw potentially contaminated items (e.g., used tissues) in the trash.
- ***Avoid Close Contact/Secondary Contact with People and Potentially Contaminated Surfaces***
  - Apply appropriate social distance (6+ feet).
  - Stop handshaking—use and utilize other noncontact methods for greeting.
  - Do not work in areas with limited ventilation with other Site workers (e.g., small work trailer which lacks HVAC system). If working in a trailer, the following conditions must be met: limited to 4 workers, large enough to have the ability to apply social distance and has open windows and/or operational HVAC to ensure proper ventilation of the workspace.
  - Morning tailgate/safety meetings shall occur outside and not within work trailers.
    - Do not require employees or subcontractors to sign in using the same tailgate form. The Site Supervisor/SHSO should record names of those in attendance on the form.
    - If the Site has more than 10 workers, separate tailgate meetings should be performed in smaller groups.
  - Do not share equipment or other items with co-workers and subcontractors unless wearing appropriate PPE (e.g., nitrile gloves). Assume equipment and other surfaces are potentially contaminated and remove gloves aseptically.
  - If receiving labware or other equipment disinfect to the extent feasible. If there are concerns for contaminating labware please wear appropriate PPE (e.g., gloves) to minimize contact.
  - Contact your lab/equipment vendor to confirm equipment is properly disinfected prior to being shipped.
  - Do not carpool with others (e.g., clients, coworkers).
  - For company owned vehicles limit sharing of vehicles with coworkers. If unable to limit sharing of company owned vehicles, properly disinfect vehicle before driving with a focus on commonly touched surfaces (e.g., steering wheels, shifters, buttons, etc.).
  - Use caution when using public restrooms, portable toilets. Use paper towel as a barrier when touching door handles and faucets.
- ***Cleaning and Disinfecting***
  - Clean and disinfect frequently touched surfaces daily. Commonly touched items can include but are not limited to tables, doorknobs, light switches, countertops, handles, desks, phones, keyboards, toilets, faucets, sinks, and field equipment (i.e., photo-ionization detector, field equipment).
  - **Hard (Non-porous) Surfaces**
    - If surfaces are dirty, they should be cleaned with a detergent/soap and water prior to disinfection.

- Refer to the manufacturer's instructions to ensure safe and effective use of the product and wear appropriate personal protective equipment (e.g., gloves, safety glasses, face shield).
- Many products require:
  - Keeping surface wet for a period of time (i.e., contact time)
    - Refer to manufacturer's instructions outlining adequate contact time.
  - Precautions such as wearing gloves and making sure you have good ventilation during use of the product.
- Disposable gloves should be removed aseptically and discarded after cleaning. Wash hands immediately following removal of gloves. Refer to Appendix C for how to remove gloves aseptically.
- For disinfection, diluted household bleach solutions, alcohol solutions with at least 70% alcohol, and most common EPA-registered household disinfectants should be effective.
  - Diluted household bleach solutions can be used if appropriate for the surface. Follow manufacturer's instructions for application and proper ventilation. Check to ensure the product is not past its expiration date. Never mix household bleach with ammonia or any other cleanser. Unexpired household bleach will be effective against coronaviruses when properly diluted. Leave the solution on the surface for at least 1 minute.
    - Prepare a bleach solution by mixing:
      - 5 tablespoons (1/3 cup) bleach per gallon of water or
      - 4 teaspoons bleach per quart of water
- Products with EPA-approved emerging viral pathogen claims are expected to be effective against COVID-19. Follow the manufacturer's instructions for all cleaning and disinfecting products (e.g., concentration, application method and contact time, etc.).

- **Soft (Porous) Surfaces**
  - For soft (porous) surfaces, remove visible contamination if present and clean with appropriate cleaners indicated for use on the surfaces. After cleaning:
    - Launder items as appropriate in accordance with the manufacturer's instructions. If possible, launder using the warmest appropriate water setting for the item and dry items completely; or
    - Use products with the EPA-approved emerging viral pathogens that claim they are suitable for porous surfaces.
- **Electronics**
  - For electronics such as tablets, touch screens, keyboards, remote controls, etc. remove visible contamination if present.
    - Follow the manufacturer's instructions for all cleaning and disinfection products.
    - Consider use of wipeable covers for electronics.
    - If no manufacturer guidance is available, consider the use of alcohol-based wipes or sprays containing at least 70% alcohol to disinfect touch screens. Dry surfaces thoroughly to avoid pooling of liquids.
- ***Linens, Clothing, and Other Items that Go in the Laundry***
  - Although it is unlikely field clothing would become potentially contaminated with COVID-19, it is recommended that field staff regularly launder field clothing following any field event upon returning home.
  - In order to minimize the possibility of dispersing the virus from potentially contaminated clothing, do not shake dirty laundry.
  - Wash items as appropriate in accordance with the manufacturer's instructions. If possible, launder items using the warmest appropriate water setting for the items and dry items completely.
  - Clean and disinfect hampers or other containers used for transporting laundry according to guidance listed above.

10. CLOTH FACE COVERINGS

The CDC recommends the use of cloth face coverings in public settings where other social distancing measures are difficult to maintain, such as grocery stores and pharmacies, and especially in areas of significant community-based transmission. This recommendation is based on recent studies and an understanding that a significant portion of asymptomatic, as well as pre-symptomatic, individuals can shed the virus to others before showing symptoms. Studies indicate that COVID-19 can spread among people interacting in close proximity through speaking, coughing, or sneezing. The purpose of the cloth covering is NOT to provide protection to the wearer, but to protect the wearer from unknowingly infecting others if they are asymptomatic/pre-symptomatic. The use of cloth face coverings is to supplement and NOT replace the existing practices outlined above.

Based on existing studies and on-going recommendations and/or requirements from federal, state, and local entities, Roux is recommending the use of cloth face coverings, when appropriate. Appropriate use is defined when local authorities or clients require the use of cloth face coverings in conjunction with established social distancing, or if an employee elects to use a cloth covering on their own accord. Roux will provide cloth face coverings that shall meet the basic requirements outlined by the CDC guidance.

Cloth Face Coverings should:

- Fit snugly but comfortably against the side of the face;
- Covers your nose and mouth and secure it under your chin;
- Include multiple layers of fabric;
- Allow for breathing without restriction; and
- Be able to be laundered and machine dried with no damage or change to shape.

When donning and doffing the cloth face covering, individuals should avoid touching their eyes, nose, and mouth. Following removal of the cloth face covering, employees should wash their hands immediately using the guidelines described in Section 8 above. Cloth face coverings should be routinely washed depending on the frequency of use.

The CDC does not recommend the use of gaiters or face shields. Evaluation of these face covers is on-going but effectiveness is unknown at this time. Masks with exhalation valves or vents should NOT be worn to help prevent the person wearing the mask from spreading COVID-19 to others (source control).

Note, the cloth face coverings recommended are not surgical masks or N-95 respirators. Those are critical supplies that must continue to be reserved for healthcare workers and other medical first responders, as recommended by current CDC guidance. Should there be a requirement for workers to be in respiratory protection (e.g., full-face respirator w/cartridges, P100, N95 respirators), it shall be addressed during the project pre-planning phase, which includes discussions with the PP and OM in consultation with CHSM.

11. HOTEL SELECTION PROCESS AND OVERNIGHT/REMOTE WORK

Hotel Selection

Due to the current COVID-19 situation, Roux is recommending overnight travel be limited to the extent possible. If there is a project requiring the overnight stay at a hotel, accommodations shall be made only after the hotel and hotel's location have been vetted in accordance with Roux's established guidance as defined below. The Project Team, which includes the Project Manager (PM) and PP along with the OM, in consultation with the CHSM, shall verify the hotel has appropriate protocols in place to limit the potential exposure and spread of COVID- 19 through proper cleaning and disinfection practices. Discussions with the hotel shall include, but are not limited to, measures taken to keep guests safe during their stay, guest room sanitization schedule, training of staff regarding disinfecting protocols using EPA-approved disinfectants, hotel staff fitness for duty requirements, etc. Some example questions are listed below. Following the initial hotel assessment by the Project Team, the OM and the CHSM shall review the hotel assessment findings prior to the CHSM's authorization that the hotel may be used by any Roux employees.

Sample Questions for Evaluating Hotels

1. Is there an established COVID-19 guidance/policy your location is following?
2. What additional measures are being implemented to keep workers and customers safe?; (e.g. signs/placards, social-distancing/mask reminders)
3. Is there a guest room sanitization schedule?
4. Have staff been trained on properly cleaning/disinfecting areas?
5. What types of disinfectants are in use at your location?
6. How are you evaluating staff fitness for duty? (e.g., temperature checks, not reporting to work when sick, etc.)

Employees staying overnight should abide by the following guidance:

- Ensure you properly disinfect your room upon arrival. This should include a wipe down of all commonly touched surfaces with an approved disinfectant. Use appropriate PPE (e.g., nitrile gloves) when disinfecting surfaces.
- Place the "Do Not Disturb" placard on the room while away and consider limiting hotel housekeeping service to the extent feasible (e.g., not having the room cleaned each day) to minimize potential secondary contact with others.
- Do not spend any more time in hotel common areas (i.e., lobby, hallways, etc.) than is necessary.
- Follow proper Infection Prevention Measures found within Section 8 above.
- Have meals in your hotel room after disinfecting outer package surfaces, as outlined in Section 8 above. Do not eat in public spaces or restaurants.
- If the hotel has a restaurant or café, do not have your meal in a common area; instead order food to be picked up or delivered to your room. If delivered, opt for contactless delivery (left outside the door, delivery person knocks and leaves). Always use your own pen if you need to sign something.
- Employees may also pick up food from takeout locations, order groceries or food for delivery to the hotel. Call local restaurants to order food for delivery (call the hotel lobby for recommendations) or use food ordering apps. Some apps have options for contactless delivery.

12. TRANSPORTATION-RENTAL CARS AND ROUX-OWNED VEHICLES

Rental Cars

Due to the current COVID-19 situation, Roux recommends rental car usage be limited to the extent possible. If there is a project requiring the use of a rental car (e.g. truck/van), accommodations shall be made only after the rental car company and their store's location have been vetted in accordance with Roux's established guidance, as defined below. The Project Team (PM and PP) and OM in consultation with the CHSM shall verify the rental company where you are picking up your vehicle has appropriate protocols in place to limit the potential exposure and spread of COVID- 19 through proper cleaning and disinfection practices. Discussions with the rental car company shall include, but are not limited to, measures to be taken to keep customers safe during pickup/drop-off, rental car disinfection protocols, training of staff regarding disinfecting protocols using EPA-approved disinfectants, rental car company staff fitness for duty requirements, etc. Some example questions are listed below. Following the initial rental car company store assessment by the Project Team, the OM and the CHSM shall review the rental car company assessment findings prior to the CHSM's authorization that the rental car company store may be used by any Roux employees.

Sample Questions for Evaluating Rental Car Companies

1. Is there an established COVID-19 guidance your location is following?
2. What additional measures are being implemented to keep workers and customers safe?
3. Is there a car sanitization schedule?

4. Have staff been trained on properly cleaning/disinfecting vehicles?
5. What types of disinfections are in use at your location?
6. How are you evaluating staff fitness for duty? (e.g., temperature checks, not reporting to work when sick, etc.)

Upon vehicle pickup, employees shall don nitrile gloves and safety glasses and clean/disinfect all high-touch surfaces (steering wheel, knobs, door handles, turn signals, radio, etc.) by wiping thoroughly with approved disinfectants (following manufacturer's instructions). Aseptically remove gloves and dispose of them along with rags/wipes, appropriately. Wash hands or use hand sanitizer immediately after each episode of cleaning. Due to social distancing requirements, personnel shall not carpool to destinations.

Roux-Owned Vehicles

Due to the current COVID-19 situation, Roux-owned vehicles should be dedicated to individual employees to the extent feasible, and if authorized by the OM. In the case this cannot be accommodated, employees shall don nitrile gloves and safety glasses, and clean/disinfect all high-touch surfaces (steering wheel, knobs, door handles, turn signals, radio, etc.) by wiping thoroughly with approved disinfectants (following manufacturer's instructions). This cleaning and disinfection shall occur before and after each use of the vehicle. Aseptically remove gloves and dispose of them along with rags/wipes, appropriately. Wash hands or use hand sanitizer immediately after each episode of cleaning. Due to social distancing requirements, personnel shall not carpool to destinations.

APPENDIX A

Roux Subcontractor Work Crew

COVID-19 Daily Health Screening Questionnaire

Subcontractor Work Crew
COVID-19 Daily Health Attestation

Date:
Company Name:
Supervisor Name: Signature:
Project Name:
Site Address:
Number of Workers on site:

Prior to entry onto a field site, the following questions shall be asked by the Subcontractor Supervisor to their work crew.

It is preferred this questionnaire is completed for each individual prior to their arrival at the field site. If the answer to any of these questions is YES, the worker is not to report to the field site and seek proper medical advice, in accordance with CDC Guidelines.

The Subcontractor Supervisor must provide this form on a daily basis to the Roux primary contact for the project and notify Roux of any YES responses.

1. Have you experienced any signs/symptoms of COVID-19 such as fever (≥100.4°F), cough, shortness of breath, chills, fatigue, muscle/body aches, headache, new loss of taste or smell, sore throat, congestion or runny nose, nausea/vomiting or diarrhea in the last 14 days?

2. Have you been in close contact* with someone who is suspected or confirmed to have COVID-19 or who is under investigation for COVID-19 within the last 14 days?

*Close contact is defined as someone who was within 6 feet of an infected person for at least 15 minutes or coming into direct contact with secretions (e.g. sharing utensils, being coughed on) from an infected person.

3. Have you traveled outside of the country, been on a cruise ship and/or traveled to areas within the United States which have state mandated travel restrictions in the last 14 days?

4. Have you tested positive for COVID-19 within the last 14 days?

Please list the crew member's names on site for the day.

1.	9.
2.	10.
3.	11.
4.	12.
5.	13.
6.	14.
7.	15.
8.	16.

APPENDIX B

Job Safety Analysis-Working in Areas Affected by COVID-19

JOB SAFETY ANALYSIS	Ctrl. No. CVD-19	DATE: 04/16/2020	☒ NEW ☐ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
Generic	**Fieldwork**	**Working in Areas Affected by Coronavirus**

DEVELOPMENT TEAM	POSITION / TITLE	REVIEWED BY:	POSITION / TITLE
Kristina DeLuca	Health and Safety Specialist	Brian Hobbs	CHSM

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST	☐ GOGGLES	☐ AIR PURIFYING RESPIRATOR	☒ GLOVES – Leather/cut-resistant in field and nitrile as needed
☒ HARD HAT – In field	☐ FACE SHIELD	☐ SUPPLIED RESPIRATOR	
☐ LIFELINE / BODY HARNESS	☐ HEARING PROTECTION	☒ PPE CLOTHING – High visibility vest in field	☐ OTHER
☒ SAFETY GLASSES – In field	☒ SAFETY SHOES – Steel/composite toe in fie		

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Cloth face covering, nitrile gloves, hand soap, water source, hand sanitizer, disinfectant spray and disinfectant wipes.

Commitment to Safety – All personnel onsite will actively participate in SPSA performance by verbalizing SPSAs throughout the day.

SOCIAL DISTANCING: Maintain 6' of distance between yourself and all other people at all times. If you do not believe the scope of work can be conducted while maintaining this distance, contact your Project Manager immediately.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Project Preplanning	N/A	• Review and follow COVID-19 CDC, Roux, Client and local orders/protocols. • Ensure all workers are fit for duty - anyone feeling sick should remain at home even if symptoms do not align with COVID-19. If a worker has been in contact with someone potentially positive or positive for COVID-19, contact your Office Manager. • Determine PPE needs and ensure adequate supply of disinfectant wipes/spray, soap and water or hand sanitizer at Site. Due to high demands and limited supply, plan ahead. • Use the minimum number of employees necessary to safely complete the work.
2. Mobilization	**Exposure:** Becoming infected or infecting co-workers	**Personal/Rental/Roux Owned Vehicle** • Do not carpool. • Use the same vehicle every day and do not share with co-workers. • Verify workers/other people are not approaching vehicle prior to exiting the vehicle. Maintain 6' of distance from others. • DO not valet your car or allow others to use your car. If necessary, don nitrile gloves and safety glasses and clean/disinfect all high touch surfaces (steering wheel, knobs, door handles, turn signals, radio, etc.) by wiping thoroughly with approved disinfectants (follow manufacturer's instructions). This cleaning and disinfection shall occur before and after each use of the vehicle. Aseptically remove gloves and dispose of them along with rags/wipes, appropriately. Wash hands or use hand sanitizer immediately after each episode of cleaning. **Public Transportation** • Public transit should not be used unless absolutely necessary. Consider renting a car rather than taking public transit. If public transit is required, wear appropriate PPE and apply social distancing (6 ft). Use proper donning and doffing procedures for nitrile gloves. Wash hands or use hand sanitizer immediately after. **Hotel Stay (Refer to COVID-19 H&S Guidance for more info)** • If a hotel stay is deemed necessary for the given field work, ensure that you disinfect your room upon initial arrival and returning each day. Disinfect all surfaces of your room with an appropriate disinfectant using nitrile gloves. Use proper donning and doffing procedures for nitrile gloves. • Place the "Do Not Disturb" placard on the room while away and limit housekeeping services to the extent feasible during your stay to minimize the reintroduction and spread of the virus from others. Minimize, or avoid entirely, time spent in hotel common areas (i.e., the lobby, dining areas, gyms, etc.). Wash hands or use hand sanitizer often.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards, energy source; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

3. Tailgate Meeting	**Exposure:** Becoming infected or infecting co-workers	• Must occur outside or remotely (i.e. video or conference call). • Maintain at least a 6+ ft distance between you and others. • Discuss primary infection prevention measures listed below. • Do not require employees or subcontractors to sign in, the Site Supervisor shall record names on the attendance form. • If the Site has more than 10 workers, separate tailgate meetings should be performed. • Discuss COVID-19 symptoms with coworkers and subcontractors to ensure fitness for duty. Anyone exhibiting signs or symptoms should be instructed to leave the Site, contact your Project Manager.
4. Site Activities	**Exposure:** Becoming infected or infecting co-workers	• Coordinate field activities at the beginning of the day (i.e. Tailgate meeting) to minimize time spent in crowded spaces or overlap while completing job tasks. • Don cloth face coverings as appropriate. • Apply social distancing (6+ ft) when interacting with others. If anyone comes within 6 ft of you while conducting work and your work prevents you from moving away, politely ask them to move back. If others are unable to move from your space, stop work and leave area. • Do not shake hands or touch others. • Do not share equipment or other items with co-workers and subcontractors unless wearing appropriate PPE (e.g. nitrile gloves). Assume equipment and other surfaces are potentially contaminated and remove gloves aseptically (See Appendix B of Roux Interim H&S Guidance for proper glove removal). • If anyone is coughing or sneezing in your vicinity, stop work and leave the area. • Do not work in areas with limited ventilation with others. • Cover your mouth and nose with tissue or paper towel or with your elbow when coughing or sneezing and wash hands or use hand sanitizer immediately after. If sick contact SHSO/PM and leave Site immediately. • Disinfect work surfaces/areas with approved disinfectant you're responsible for (ex: desk, office doorknob, computer, etc.) at least once at the beginning of your shift and at least once at the end of your shift with either sanitizing wipes or disinfectant spray. • Phones should be operated hands free to extent feasible. Sanitize your phone on a regular basis. Disinfection should also take place whenever suspected contaminated material comes in contact with any work surfaces/areas. Wash hands or use hand sanitizer immediately after. • Avoid public spaces and going out to eat by bringing your own lunch to the Site. If performing work in high density urban areas, it is recommended all food must be consumed at or in your vehicle. Wash hands or use hand sanitizer before eating and immediately after.

Primary Infection Prevention Measures

- Wash your hands often with soap and water for at least 20 seconds.
  - If soap and water are not available, use an alcohol-based sanitizer that contains at least 60% ethanol or 70% isopropanol. Key times to wash hands include after blowing your nose, coughing or sneezing, after using the restroom, and before eating or preparing food.
- Do not touch your eyes, face, nose and mouth with unwashed hands.
- Cover your mouth and nose with a tissue when you cough or sneeze or use the inside of your elbow. Throw potentially contaminated items (e.g. used tissues) in the trash.
- Avoid close contact/secondary contact with people and potentially contaminated surfaces.
  - Apply appropriate social distance (6+ feet).
  - Stop handshaking/touching others and use caution when accessing public spaces.
- Clean and disinfect frequently touched surfaces daily. Commonly touched items can include but are not limited to tables, doorknobs, light switches, countertops, handles, desks, phones, keyboard, toilets, sinks and field equipment. If surfaces are dirty, they should be cleaned with soap and water prior to disinfection. If surface cannot be cleaned/disinfected, then wash hands or use sanitizer as soon as possible.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy source – electricity, pressure, compression/tension.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

APPENDIX C

How to Remove Gloves

How to Remove Gloves

To protect yourself, use the following steps to take off gloves

1

Grasp the outside of one glove at the wrist. Do not touch your bare skin.

2

Peel the glove away from your body, pulling it inside out.

3

Hold the glove you just removed in your gloved hand.

4

Peel off the second glove by putting your fingers inside the glove at the top of your wrist.

5

Turn the second glove inside out while pulling it away from your body, leaving the first glove inside the second.

6

Dispose of the gloves safely. Do not reuse the gloves.

7

Clean your hands immediately after removing gloves.

APPENDIX D

Personal Protective Equipment (PPE) Management Program

PERSONAL PROTECTIVE EQUIPMENT MANAGEMENT PROGRAM

CORPORATE HEALTH AND SAFETY MANAGER	**:**	**Brian Hobbs, CIH, CSP**
EFFECTIVE DATE	**:**	**01/19**
REVISION NUMBER	**:**	**4**

TABLE OF CONTENTS

1. PURPOSE 1
2. SCOPE AND APPLICABILITY 1
3. PROCEDURES 1
3.1 Introduction 1
3.2 Types of PPE 1
3.3 Protective Clothing Selection Criteria 2
3.3.1 Chemicals Present 2
3.3.2 Concentration of the Chemical(s) 2
3.3.3 Physical State 3
3.3.4 Length of Exposure 3
3.3.5 Abrasion 3
3.3.6 Dexterity 3
3.3.7 Ability to Decontaminate 3
3.3.8 Climactic Conditions 3
3.3.9 Work Load 4
3.4 Types of Protective Materials 4
3.5 Protection Levels 4
3.5.1 Level A Protection 4
3.5.2 Level B Protection 5
3.5.3 Level C Protection 6
3.5.4 Level D Protection 6
3.5.5 Level E Protection 6
3.5.6 Additional Considerations 7

1. PURPOSE

Roux Associates, Inc. and its affiliated companies, Roux Environmental Engineering and Geology, D.P.C, and Remedial Engineering (collectively, "Roux") has instituted the following program to establish guidelines for the selection of personal protective equipment (PPE) for use by Roux personnel performing field activities in hazardous environments. PPE is not meant to be a substitute for engineering, work practice, and/or administrative controls, but PPE should be used in conjunction with these controls to protect the employees in the work place. Clothing, body coverings, and other accessories designed to prevent worker exposure to workplace hazards are all types of PPE. To ensure adequate PPE employee-owned PPE is evaluated on a case-by-case basis to insure its adequacy, maintenance and sanitation.

2. SCOPE AND APPLICABILITY

These guidelines apply to all PPE selection decisions to be made in implementing the Roux program. The foundations for this program are the numerous Occupational Health and Safety Administration (OSHA) standards related to PPE cited in 29 CFR 1910 Subpart I, 29 CFR 1926 Subpart E, and the hazardous environment work employee protection requirements under the OSHA Hazardous Waste Operations and Emergency Response (HAZWOPER) standard at 29 CFR 1910.120 and 1926.65. To ensure hazard assessments are documented the levels of protection, types of protection and tasks requiring protection are covered in site-specific Health and Safety Plans (HASPs) and Job Safety Analyses (JSAs).

3. PROCEDURES

Due to the varied nature of site activities and the different potential hazards associated with different sites, several aspects must be considered when selecting PPE. The following text describes PPE selection logic and provides guidelines and requirements for the appropriate selection and use of PPE.

3.1 Introduction

To harm the body, chemicals must first gain entrance. The intact skin and the respiratory tract are usually the first body tissues attacked by chemical contaminants. These tissues provide barriers to some chemicals but in many cases, are damaged themselves or are highly permeable by certain chemical compounds. Personal protective equipment therefore is used to minimize or eliminate chemical compounds coming into contact with these first barrier tissues.

The proper selection of equipment is important in preventing exposures. The PM making the selection will have to take several factors into consideration. The level of protection, type and kind of equipment selected depends on the hazardous conditions and in some cases cost, availability, compatibility with other equipment, and performance. An accurate assessment of all these factors must be made before work can be safely carried out.

3.2 Types of PPE

The type and selection of PPE must meet certain general criteria and requirements as required under OSHA 29 CFR 1910.132 and 1926.95. In addition to these general requirements, specific requirements and specifications exist for some types of PPE that form the basis of the protective clothing scheme. Following is a list of the common types of specific PPE and the specific requirements for the PPE type, where applicable:

1. Hard Hats - Regulated by 29 CFR 1910.135 and 1926.100; and, specified in ANSI Z89.1.

2. Face Shields and Safety Glasses - Regulated by 29 CFR 1910.133 and 1926.102; and, specified in ANSI Z87.1.
3. Respiratory Protection - Regulated by 29 CFR 1910.134 and 1926.103.
4. Hand Protection - Not specifically regulated.
5. Foot Protection - Regulated by 29 CFR 1910.136 and 1926.96; and, specified in ANSI Z41.1.
6. Protective Clothing (e.g., fully encapsulated suits, aprons) - Not specifically regulated.

3.3 Protective Clothing Selection Criteria

3.3.1 Chemicals Present

The most important factor in selecting PPE is the determination of what chemicals the employee may be exposed to. On field investigations, the number of chemicals may range from a few to several hundred. The exact chemicals or group of chemicals present at the site (certain groups tend to require similar protection) can be determined by collecting and analyzing samples of the air, soil, water, or other site media. When data are lacking, research into the materials used or stored at the site can be used to infer chemicals possibly on the site.

Once the known or suspected chemicals have been identified, and taking into consideration the type of work to be performed, the most appropriate clothing shall be selected.

Protective garments are made of several different substances for protection against specific chemicals. There is no universal protective material. All will decompose, be permeated by, or otherwise fail to protect under given circumstances. Fortunately, most manufacturers make guides to the use of their products (i.e., Dupont's Tyvek™ Permeation Guide). These guides are usually for gloves and coveralls and typically provide information regarding chemical degradation rates (failure of the material to maintain structural integrity when in contact with the chemical), and may provide information on the permeation rate (whether or not the material allows the chemical to pass through). When permeation tables are available, they shall be used in conjunction with degradation tables to determine the most appropriate protective material.

During most site work, chemicals are usually in mixed combinations and the protective materials are not in continuous contact with pure chemicals for long periods of time; therefore, the selected material may be adequate for the particular chemical and type of work being performed, yet not the "best" protecting material for all site chemicals and activities. Selection shall depend upon the most hazardous chemicals based on their hazards and concentrations. Sometimes layering, using several different layers of protective materials, affords the best protection.

3.3.2 Concentration of the Chemical(s)

One of the major criteria for selecting protective material is the concentration of the chemical(s) in air, liquid, and/or solid state. Airborne and liquid chemical concentrations should be compared to the OSHA standards and/or American Conference of Governmental Industrial Hygienists (ACGIH) and National Institute for Occupational Safety and Health (NIOSH) guidelines to determine the level of skin or other absorptive surface (e.g., eyes) protection needed. While these standards are not designed specifically for skin exposed directly to the liquid, they may provide skin designations indicative of chemicals known to have significant skin or dermal absorption effects. For example, airborne levels of PCB on-site may be

low because it is not very volatile, so the inhalation hazard may be minimal; however, PCB-containing liquid coming in direct contact with the skin may cause overexposure. Thus, PCB has been assigned a skin designation in both the OSHA and ACGIH exposure limit tables.

3.3.3 Physical State

The characteristics of a chemical may range from nontoxic to extremely toxic depending on its physical state. Inorganic lead in soil would not be considered toxic to site personnel, unless it became airborne, since it is generally not absorbed through the intact skin. Organic lead in a liquid could be readily absorbed. Soil is frequently contaminated with hazardous materials. Concentrations will vary from a few parts per million to nearly one hundred percent. The degree of hazard is dependent on the type of soil and concentration of the chemical. Generally speaking, "dry" soils do not cause a hazard to site personnel if they take minimal precautions such as wearing some type of lightweight gloves.

3.3.4 Length of Exposure

The length of time a material is exposed to a chemical increases the probability of breakthrough. Determinations of actual breakthrough times for short-term exposures indicate that several different materials can be used which would be considered inadequate under long-term exposures. It should be kept in mind that during testing, a pure (100% composition) liquid is usually placed in direct contact with the material producing a worst-case situation.

3.3.5 Abrasion

When selecting protective clothing, the job the employee is engaged in must be taken into consideration. Persons moving drums or performing other manual tasks may require added protection for their hands, lower chest and thighs. The use of leather gloves and a heavy apron over the other normal protective clothing will help prevent damage to the normal PPE and thus reduce worker exposures.

3.3.6 Dexterity

Although protection from skin and inhalation hazards is the primary concern when selecting PPE, the ability to perform the assigned task must be maintained. For example, personnel cannot be expected to perform work that requires fine dexterity if they must wear a thick glove. Therefore, the PPE selection process must consider the task being performed and provide PPE alternatives or techniques that allow dexterity to be maintained while still protecting the worker (e.g., wearing tight latex gloves over more bulky hand protection to increase dexterity).

3.3.7 Ability to Decontaminate

If disposable clothing cannot be used, the ability to decontaminate the materials selected must be taken into consideration. Once a chemical contacts the material, it must be cleaned before it can be reused. If the chemical has completely permeated the material, it is unlikely that the clothing can be adequately decontaminated and the material should be discarded.

3.3.8 Climactic Conditions

The human body works best with few restraints from clothing. Protective clothing adds a burden by adding weight and restricting movement as well as preventing the natural cooling process. In severe situations, a modified work program must be used.

Some materials act differently when they are very hot and very cold. For example, PVC becomes almost brittle in very cold temperatures. If there are any questions about the stability of the protective materials under different conditions, the manufacturer should be contacted.

3.3.9 Work Load

Like climactic conditions, the type of work activity may affect work duration and the ability or personnel to perform certain tasks. Similarly, the amount of protective materials a person wears will affect their ability to perform certain tasks. For example, a person in a total encapsulating suit, even at 72 ^{o}F, cannot work for more than a short period of time without requiring a break.

The work schedule should be adjusted to maintain the health of the employees. Special consideration should be given to the selection of clothing that both protects and adds the least burden when personnel are required to perform strenuous tasks. Excessive bodily stress frequently represents the most significant hazard encountered during field work.

3.4 Types of Protective Materials

1. Cellulose or Paper
2. Natural and Synthetic Fibers
    a. Tyvek™
    b. Nomex™
3. Elastomers
    a. Polyethylene
    b. Saran
    c. Polyvinyl Chloride (PVC)
    d. Neoprene
    e. Butyl Rubber
    f. Viton

3.5 Protection Levels

3.5.1 Level A Protection

Level A protection (a fully encapsulated suit) is used when skin hazards exist or when there is no known data that positively rule out skin and other absorption hazards. Since Level A protection is extremely physiologically and psychologically stressful, the decision to use this protection must be carefully considered. At no time will Level A work be performed without the consent of the OM. The following conditions suggest a need for Level A protection:

- confined facilities where probability of skin contact is high;
- sites containing known skin hazards;
- sites with no established history to rule out skin and other absorption hazards;
- atmosphere immediately dangerous to life and health (IDLH) through the skin absorption route;
- site exhibiting signs of acute mammalian toxicity (e.g., dead animals, illnesses associated with past entry into site by humans);

- sites at which sealed drums of unknown materials must be opened;
- total atmospheric readings on the Photoionization Detector (PID), Flame Ionization Detector (FID), and similar instruments indicate 500 to 1,000 ppm of unidentified substances; and
- extremely hazardous substances (e.g., cyanide compounds, concentrated pesticides, Department of Transportation Poison "A" materials, suspected carcinogens and infectious substances) are known or suspected to be present and skin contact is possible.

The following items constitute Level A protection:

- open circuit, pressure-demand self-contained breathing apparatus (SCBA);
- totally encapsulated suit;
- gloves, inner (surgical type);
- gloves, outer;
- chemical protective;
- boots, chemical protective, steel toe and shank;
- radiation detector (if applicable); and
- communications.

3.5.2 Level B Protection

Level B protection is utilized when the highest level of respiratory protection is needed but hazardous material exposure to the few unprotected areas of the body is unlikely.

The following conditions suggest a need for Level B protection:

- the type and atmospheric concentration of toxic substances have been identified and they require the highest level of respiratory protection;
- IDLH atmospheres where the substance or concentration in the air does not present a severe skin hazard;
- the type and concentrations of toxic substances do not meet the selection criteria permitting the use of air purifying respirators; and
- it is highly unlikely that the work being done will generate high concentrations of vapors, gases or particulates, or splashes of materials that will affect the skin of personnel.

Personal protective equipment for Level B includes:

- open circuit, pressure-demand SCBA;
- chemical protective clothing:
- overalls and long-sleeve jacket; or
- coveralls;
- gloves, inner (surgical type); gloves, outer, chemical protective;
- boots, chemical protective, steel toe and shank; and
- communications optional.

3.5.3 Level C Protection

Level C protection is utilized when both skin and respiratory hazards are well defined and the criteria for the use of negative pressure respirators have been fulfilled (i.e., known contaminants and contaminant concentrations, acceptable oxygen levels, approved filter/cartridge available, known cartridge service life, etc.). Level C protection may require carrying an emergency escape respirator during certain initial entry and site reconnaissance situations, or when applicable thereafter.

Personal protective equipment for Level C typically includes:

- full facepiece air-purifying respirator;
- emergency escape respirator (optional);
- chemical protective clothing:
  - overalls and long-sleeved jacket; or
  - coveralls;
- gloves, inner (surgical type);
- gloves, outer, chemical protective; and
- boots, chemical protective, steel toe and shank.

3.5.4 Level D Protection

Level D is the basic work uniform. Personal protective equipment for Level D includes:

- coveralls;
- safety boots/shoes;
- eye protection;
- hand protection;
- reflective traffic safety vest (mandatory for traffic areas or railyard);
- hard hat (with face shield is optional); and
- emergency escape respirator is optional.

3.5.5 Level E Protection

Level E protection is used when radioactivity above 10 mr/hr is detected at the site. Personal protective equipment for Level E includes:

- coveralls;
- air purifying respirator;
- time limits on exposure;
- appropriate dermal protection for the type of radiation present; and
- radiation dosage monitoring.

3.5.6 Additional Considerations

Field work will contain a variety of situations due to chemicals in various concentrations and combinations. These situations may be partially ameliorated by following the work practices listed below:

1. Some sort of foot protection is needed on a site. If the ground to be worked on is contaminated with liquid and it is necessary to walk in the chemicals, some sort of protective "booties" can be worn over the boots. This cuts down on decontamination requirements. They are designed with soles to help prevent them from slipping around. If non-liquids are to be encountered, a Tyvek™ bootie could be used. If the ground contains any sharp objects, the advantage of booties is questionable. Boots should be worn with either cotton or wool socks to help absorb the perspiration.

2. If the site situation requires the use of hard hats, chin straps should be used if a person will be stooping over where his/her hat may fall off. Respirator straps should not be placed over the hard hats. This will affect the fit of the respirator.

   Some types of protective materials conduct heat and cold readily. In cold conditions, natural material clothing should be worn under the protective clothing. Protective clothing should be removed prior to allowing a person "to get warm". Applying heat, such as a space heater, to the outside of the protective clothing may drive the contaminants through. In hot weather, under clothing will absorb sweat. It is recommended that workers use all cotton undergarments.

3. Body protection should be worn and taped to prevent anything from running into the top of the boot. Gloves should be worn and taped to prevent substances from entering the top of the glove. Duct tape is preferred, but masking tape can be used. When aprons are used, they should be taped across the back for added protection. However, this should be done in such a way that the person has mobility.

4. Atmospheric conditions such as precipitation, temperature, wind direction, wind velocity, and pressure determine the behavior of contaminants in air or the potential for volatile material getting into the air. These parameters should be considered in determining the need for and the level of protection.

5. A program must be established for periodic monitoring of the air during site operations. Without an air monitoring program, any changes would go undetected and might jeopardize response personnel. Monitoring can be done with various types of air pumps and filtering devices followed by analysis of the filtration media; personnel dosimeters; and periodic walk-throughs by personnel carrying real-time survey instruments.

6. For operations in the exclusion zone, different levels of protection may be selected, and various types of chemical-resistant clothing may be worn. This selection should be based on the job function, reason for being in the area, and the potential for skin contact with, or inhalation of, the chemicals present.

7. Escape masks must be readily available when levels of respiratory protection do not include a SCBA and the possibility of an IDLH atmosphere exists. Their use can be made on a case-by-case basis. Escape masks could be strategically located at the site in areas that have higher possibilities of vapors, gases or particulates.

APPENDIX E

Subsurface Utility Clearance Management Program

SUBSURFACE UTILITY CLEARANCE MANAGEMENT PROGRAM

CORPORATE HEALTH AND SAFETY MANAGER	**:**	**Brian Hobbs, CIH, CSP**
EFFECTIVE DATE	**:**	**01/19**
REVISION NUMBER	**:**	**2**

TABLE OF CONTENTS

1. PURPOSE 1
2. SCOPE AND APPLICABILITY 1
3. PROCEDURES 1
   3.1 Before Intrusive Activities 1
   3.2 During Intrusive Activities 2
   3.3 Stop Work Authority 3

APPENDICES

Appendix A – Definitions

Appendix B – Example of Completed One Call

Appendix C – Roux Subsurface Utility Clearance Checklist

Appendix D – Utility Verification/Site Walkthrough Record

1. PURPOSE

Roux Associates, Inc. and its affiliated companies, Roux Environmental Engineering and Geology, D.P.C, and Remedial Engineering (collectively, "Roux") has instituted the following program for completing proper utility mark-outs and for conducting subsurface clearance activities. This establishes a method to ensure, to the greatest extent possible, that utilities have been identified and contact and/or damage to underground utilities and other subsurface structures will be avoided.

2. SCOPE AND APPLICABILITY

The Subsurface Utility Clearance Management Program applies to all Roux employees, its contractors and subcontractors. Employees are expected to follow this program for all intrusive work involving Roux or other personnel (e.g., contractors/subcontractors) working for Roux unless the client's requirements are more stringent. Deviation from the program regardless of the specific work activity or work location must be pre-approved based on client's site knowledge, site experience and client's willingness for the use of this program. Any and all exceptions shall be documented and pre-approved by the Project Principal and the Office Manager.

3. PROCEDURES

3.1 Before Intrusive Activities

During the project kick-off meeting for intrusive activities the PM will review the Roux Subsurface Utility Clearance Checklist and Utility Verification (Appendix C) / Site Walkthrough Record (Appendix D) and the below bullet points with the project field team:

(Please note that these are intended as general reminders only and should not be solely relied upon.)

- Ensure the Mark-out / Stake-out Request Information Sheet (or one-call report) is complete and accurate for the site including address and cross streets and review for missing utilities. (Note: utility mark-out organizations do not have contracts with all utilities and it is often necessary to contact certain utilities separately such as the local water and sewer authorities).
- Have written confirmation prior to mobilizing to the site that the firm or Roux personnel performing the intrusive activity has correctly completed the mark-out notification process including requesting mark-outs, waiting for mark-outs to be applied to ground surfaces at the site, and receiving written confirmation of findings (via fax or email) from utility operators for all known or suspected utilities in the proposed area of intrusive activity, and provided utility owner written confirmation to Roux personnel for review and project files documentation.
- Do not begin any intrusive activity until all utilities mark-out has been completed (i.e., did all utilities mark-out the site?) and any unresolved mark-out issues are finalized. Perform a site walk to review the existing utilities and determine if said utilities have been located by the utility locators.

  (Note: The Tolerance Zone is defined as two feet plus half of the diameter or half of the greatest dimension (for elliptical sewers, duct banks and other non-cylindrical utilities) of a utility and two feet from the outside edge of any subsurface structure.)
- Install Pre-Clearance exploratory test holes (e.g., hand-dug test holes or other soft digging techniques) for the first 5-ft below land surface (BLS) at each location prior to conducting mechanized intrusive activities. The size of the pre-clearance exploratory test hole should be at a minimum twice the diameter of any downhole tool or boring device. (Note: Pre-Clearance exploratory test holes should be defined in the SOW/proposal provided to the client to prevent project delays and to allow adequate time for PM and PP to evaluate alternative approaches for the project. Alternative approaches will need to be pre-approved by the OM.

- For excavations, all utilities need to be marked and then exposed by hand following the protocols in this program. Pre-clearing for excavations may be performed by the "moat" technique (i.e., soft digging around the perimeter). In these cases, dig in small lifts (<12" for first 5 feet) using a dedicated spotter.) For Tolerance Zone work, unless otherwise agreed upon with the Utility Operator, work within the tolerance zone requires verification by means of hand-dug test holes performed to expose the utility. Once structures have been verified a minimum clearance of two feet must be maintained between the utility and any powered equipment.
- In addition, the following activities should be conducted:
  - Review the work scope to be performed with the site owner/tenant to determine if it may impact any utilities;
  - Attempt to procure any utility maps or historic drawings of subsurface conditions of the site;
  - **Determine the need for utility owner companies to be contacted or to have their representatives on site**;
  - Where mark-outs terminate at the property boundary, consider the use of private utility locating / GPR / geophysical-type services which may be helpful in locating utilities. Use of private utility locating firms, however, does not eliminate the legal requirement for the Excavator firm to submit a request for Public Utility Mark-outs. Also, the information provided by the service may be inaccurate and unable to locate subsurface utilities and structures in urban areas, landfills, urban fill areas and below reinforced slabs, etc. They should not be relied upon as the only means of performing utility clearance;
  - Documented description of the dig site which is included in the projects Health and Safety Plan (HASP) and one call report will be maintained in the field and distributed amongst Roux personnel its contractors and subcontractors; and
  - Documentation of the actual placement of mark outs in the field shall be collected using dated pictures, videos and/or sketches with distance from markings to fixed objects. All documentation shall be maintained within the project file.

3.2 During Intrusive Activities

The PM, field team lead or personnel performing oversight is to:

- Ensure the mark-out remains valid. (In certain states there are limits regarding the duration of time after the mark-out was applied to the ground surface work can be started or interrupted.) Additionally, the mark-outs must be maintained, documented, and in many cases refreshed periodically to be considered valid, this will be accomplished through calls to the one call center.
- Ensure intrusive activities are only performed within the safe boundaries of the mark-out as detailed in the One-Call Report.
- Halt all work if intrusive activities have resulted in discovery of an unmarked utility. Roux personnel shall notify the facility owner/operator and the one call center. All incidents such as this will be reported as per Roux Incident Investigation and Reporting Management Program.
- Halt all work if intrusive activities must take place outside of the safe boundaries of a mark-out and only proceed after new mark-outs are performed.
- Halt the intrusive activities and immediately consult with the PP if an unmarked utility is encountered.
- Completing any subsurface utility clearance incident reports that are necessary.

- If a utility cannot be found as marked Roux personnel shall notify the facility owner/operator directly or through the one call center. Following notification, the excavation may continue, unless otherwise specified in state law.
- Contractors/subcontractors must contact the one-call center to refresh the ticket when the excavation continues past the life of the ticket. Ticket life shall be dictated by state law however at a maximum ticket life shall not exceed 20 working days.

3.3 Stop Work Authority

Each Roux employee has Stop Work Authority which he or she will execute upon determination of any imminent safety hazard, emergency situation, or other potentially dangerous situation, such as hazardous weather conditions. This Stop Work Authority includes subsurface clearance issues such as the adequacy of a mark-out or identification during intrusive operations of an unexpected underground utility. Authorization to proceed with work will be issued by the PM/PP after such action is reviewed and resolved. The PM will initiate and execute all management notifications and contact with emergency facilities and personnel when this action is appropriate.

Appendix A - Definitions

Intrusive Work Activities	All activities such as digging or scraping the surface, including but not limited to, excavation, test pitting or trenching, soil vapor sampling or the installation of soil borings, soil vapor monitoring points and wells, or monitoring wells, and drilling within the basement slab of a recently demolished building.
Mark-out / Stake Out	The process of contracting with a competent and qualified company to confirm the presence or absence of underground utilities and structures. This process will clearly mark-out and delineate utilities that are identified so that intrusive work activities can be performed without causing disturbance or damage to the subsurface utilities and structures. After utility mark-outs are completed the soft digging will be completed prior to intrusive work.
Tolerance Zone	Defined as two feet on either side of the designated centerline of an identified utility, plus half of the diameter or half of the greatest dimension (for elliptical sewers, duct backs and other non-cylindrical utilities) of that utility and two feet from the outside edge of any subsurface structure.
Structure	For the purpose of this program a structure is defined as any underground feature that may a present potential source(s) of energy such as, but not limited to, utility vaults, bunkers, piping, electrical boxes, wires, conduits, culverts, utility lines, underground tanks and ducts.
Soft Digging	The safest way to remove material from unknown obstructions or services is by using tools such as a vactor or air knife, non-mechanical tools, or hand tools. The methods are clean and non-evasive and used for uncovering and exposing buried services, excavating and for providing a quick method of soil removal from sensitive areas.
Verification	Exploratory test-hole dug with hand tools within the Tolerance Zone to expose and verify the location, type, size, direction-of-run and depth of a utility or subsurface structure. Vacuum excavation (soft dig) methods can further facilitate exposure of a subsurface utility and accurately provide its location and identification prior to intrusive work approaching the Tolerance Zone.

Appendix B - Example of Completed One Call Report

Example Completed One-Call Report

New York 811

Send To: C_EMAIL Seq No: 744

Ticket No: 133451007 ROUTINE

Start Date: 12/16/13 Time: 7:00 AM Lead Time: 20

State: NY County: QUEENS Place: QUEENS
Dig Street: 46TH AVE Address:
Nearest Intersecting Street: VERNON BLVD
Second Intersecting Street: 11TH ST

Type of Work: SOIL BORINGS
Type of Equipment: GEOPROBE
Work Being Done For: ROUX

In Street: X On Sidewalk: X Private Property: Other:
On Property Location if Private: Front: Rear: Side:

Location of Work: MARK THE ENTIRE NORTH SIDE OF THE STREET AND SIDEWALK OF: 46TH AVE BETWEEN VERNON BLVD AND 11TH STREET

Remarks:

Nad: Lat: Lon: Zone:
ExCoord NW Lat: 40.7475399 Lon: -73.9534811 SE Lat: 40.7457406 Lon: -73.9493680

Company : ZEBRA ENVIROMENTAL Best Time: 6AM-5PM
Contact Name: DAVID VINES Phone: (516)596-6300
Field Contact: DAVID VINES Phone: (516)596-6300
Caller Address: 30 N PROSPECT AVE Fax Phone: (516)596-4422
LYNBROOK, NY 11563
Email Address: david@zebraenv.com

Additional Operators Notified:
ATTNY01 AT&T CORPORATION (903)753-3145
CEQ CONSOLIDATED EDISON CO. OF N.Y (800)778-9140
MCINY01 MCI (800)289-3427
PANYNJ01 PORT AUTHORITY OF NY & NJ (201)595-4841
VZQ VERIZON COMMUNICATIONS (516)297-1602

Link to Map for C_EMAIL: http://ny.itic.occinc.com/XGMZ-DF2-L23-YAY

Original Call Date: 12/11/13 Time: 1:15 PM Op: webusr
IMPORTANT NOTE: YOU MUST CONTACT ANY OTHER UTILITIES DIRECTLY

Appendix C - Roux Subsurface Utility Clearance Checklist

Roux Subsurface Utility Clearance Checklist ***Date of Revision – 12/3/14***

Work site set-up and work execution

ACTIVITY	Yes	No	N/A	COMMENTS INCLUDING JUSTIFICATION IF RESPONSE IS NO OR NOT APPLICABLE
Daily site safety meeting conducted, SPSAs performed, JSAs reviewed, appropriate work permits obtained.				
HASP is available and reviewed by site workers / visitors.				
Subsurface Utility Clearance Procedure has been reviewed with all site workers.				
Work area secured; traffic control established as needed. Emergency shut-off switch located. Fire extinguishers / other safety equipment available as needed.				
Utility mark-outs (public / private) clear and visible. Provide Excavator's Stake-Out Reference Number / Request Date / Time.				
Tolerance zone work identified.				
Work execution plan reviewed and adhered to (ground disturbance methods, clearance depths, any special utility protection requirements, or any other execution requirements; especially for Tolerance Zone work).				
Verbal endorsement received from Roux PM for any required field deviations to work execution plan.				

Key reminders for execution:

The Subsurface Utility Clearance Protocol should be referenced to determine all requirements while executing subsurface work. The bullet points below are intended as general reminders only and should not be solely relied upon.

- Tolerance zone is defined as two feet plus half of the diameter or half of the greatest dimension (for elliptical sewers, duct banks and other non-cylindrical utilities) of a utility and two feet from the outside of any subsurface structure.
- Install Pre-Clearance exploratory test holes (e.g., hand-dug test holes or vacuum excavation) must be performed for the first five feet below land surface (BLS) at each location prior to conducting mechanized intrusive activities. The size of the pre-clearance exploratory test hole should be at a minimum twice the diameter of any downhole tool or boring device. (Note: Pre-clearance exploratory test holes should be defined in the SOW/proposal provided to the client to prevent project delays and to allow adequate time for PM and PP to evaluate alternative approaches for the project. Alternate approaches will need to be pre-approved by the OM.
- For excavations, all utilities need to be marked and then exposed by hand following the protocols in this program. Pre-clearing for excavations may be performed by the "moat" technique (i.e., soft

digging around the perimeter). In these cases, dig in small lifts (<12" for first five feet) using a dedicated spotter.) For Tolerance Zone work, unless otherwise agreed upon with the Utility Operator, work within the tolerance zone requires verification by means of hand-dug test holes to expose the utility. Once structures have been verified a minimum clearance of two feet must be maintained between the utility and any powered equipment.

Appendix D - Utility Verification/Site Walkthrough Record

Employee Name: _____

Date: _____

Instructions: For each utility suspected at the job site, indicate location on the job site, approximate burial depth, and means of detecting the utility. Leave blank if that utility is not believed to be present.

Utility	Description of Utility Location Identified Onsite	Approx. Depth (bls)	Method / Instrumentation used to determine Utility Location	Utility Owner Response (Date/Time)	Mark Out Indicates (Clear / Conflict)
Electrical Lines					
Gas Lines					
Pipelines					
Steam Lines					
Water Lines					
Sanitary and Stormwater Sewer lines					
Pressured Air-Lines					
Tank Vent Lines					
Fiber Optic Lines					
Underground Storage Tanks					
Phone Lines/ Other					

* bls - below land surface

Site Sketch Showing Utilities:

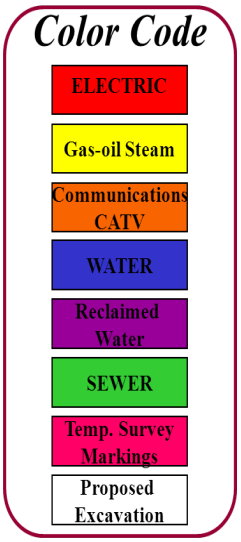

Other Comments / Findings:

Completed by: _____

Signature: _____ Date: _____

APPENDIX F

Heavy Equipment Exclusion Zone Policy

HEAVY EQUIPMENT EXCLUSION ZONE MANAGEMENT PROGRAM

CORPORATE HEALTH AND SAFETY MANAGER	:	**Brian Hobbs, CIH, CSP**
EFFECTIVE DATE	:	**01/2019**
REVISION NUMBER	:	**1**

TABLE OF CONTENTS

1. PURPOSE 2
2. SCOPE AND APPLICABILITY 2
3. PROCEDURES 2
   3.1 Exceptions 3
4. TRAINING 3

1. PURPOSE

The purpose of the Exclusion Zone Management Program is to establish the minimum clearance distance that must be maintained between workers and heavy equipment while equipment is in operation (i.e., engaged or moving). The intent is to have no personnel or equipment entering the Exclusion Zone while the equipment is in operation or moving to ensure that Roux and Subcontractor employees are not unnecessarily exposed to the hazards of the equipment.

2. SCOPE AND APPLICABILITY

This Management Program applies to all Roux Associates, Inc. and its affiliated companies, Roux Environmental Engineering and Geology, D.P.C, and Remedial Engineering (collectively, "Roux") employees and their subcontractors who are performing field work and are potentially exposed to heavy equipment. For the purpose of this program, heavy equipment includes, but is not necessarily limited to: excavation equipment, drill rigs, vacuum trucks, forklifts, lull telehandlers, man lifts, bobcats, delivery trucks, etc.

3. PROCEDURES

As specified in the following sections of this Program, an Exclusion Zones must be established and maintained during activities involving the movement/operation of heavy equipment. The Exclusion Zone requirements apply to all personnel on the site but are primarily focused on those personnel who are required to be working in the vicinity of the equipment. The exclusion zone is in effect when heavy equipment is moving or engaged (ex. movement of an arm or bucket of an excavator, rotation of an auger, lifting of a load with a forklift, raising/lowering of a man lift, etc.).

1. The Exclusion Zone must meet the following minimum requirements:
   - A minimum distance of 10 feet from all heavy equipment and loads being moved by the equipment;
   - Greater than the swing/reach radius of any moving part on the heavy equipment (i.e., for large equipment this may mean an exclusion zone distance larger than 20 feet);
   - Greater than the tip-over distance of the heavy equipment; and
   - Greater than the radius of blind spots.

   The size of the Exclusion Zone will need to be determined on a task-specific basis considering the size of the heavy equipment in use and the task being performed. Prior to all heavy equipment operations, the Exclusion Zone(s) distance must be specifically identified in the Job Safety Analysis (JSA).
2. The spotter (or another individual) should be assigned responsibility for enforcing the Exclusion Zone. The spotter should be positioned immediately outside of the Exclusion Zone within a clear line of sight of the equipment operator. The spotter must signal the operator to stop work if anyone or anything has the potential to enter or compromise the Exclusion Zone. The operator should stop work if the spotter is not within his/her line of sight. If multiple pieces of equipment are being used, each piece of equipment must have its own Exclusion Zone and spotter. For large excavation and demolition projects the spotter should be in constant radio contact (not cell phone) with the machine driver.
3. If an individual must enter the Exclusion Zone, the designated Spotter must signal the Equipment Operator to stop the equipment. Once the equipment is no longer moving (ex. movement of an arm of an excavator is STOPPED, lifting of a load with a forklift STOPPED, raising/lowering of a man lift is

STOPPED, etc.), the operator must DISENGAGE THE CONTROLS and STOP and SIGNAL BY "SHOWING HIS HANDS". This signal will indicate that it is safe for the personnel to enter the limits of the Exclusion Zone to perform the required activity. The equipment must remain completely stopped/disengaged until all personnel have exited the limits of the Exclusion Zone and the designated Spotter has signaled by "SHOWING HIS HANDS" to the Equipment Operator that it is safe to resume operations.

4. When entering the limits of the Exclusion Zone, personnel must at a minimum:
   - Establish eye contact with the operator and approach the heavy equipment in a manner that is in direct line of sight to the Equipment Operator;
   - Never walk under any suspended loads or raised booms/arms of the heavy equipment; and
   - Identify a travel path that is free of Slip/Trip/Fall hazards.
5. The Exclusion Zone should be delineated using cones with orange snow fence or solid poles between the cones, barrels, tape or other measures. For work in rights-of-way rigid barriers, such as Jersey barriers or temporary chain link fence should be used. For certain types of wide-spread or moving/mobile equipment operations, such delineation may not be practicable around pieces of equipment or individual work areas. In such instances, it is expected that the entire operation will be within a larger secure work area or that additional means will be utilized to ensure security of the work zone.

All subcontractors who provide heavy equipment operations to field projects must implement a program that meets or exceeds the expectations described above as well as any additional requirements that may be required on a client or site-specific basis.

3.1 Exceptions

It is recognized that certain heavy equipment activities may require personnel to work within the limits of the Exclusion Zone as specified in this program. Such activities may include certain excavation clearance tasks, drill crew activities or construction tasks. However, any such activity must be pre-planned with emphasis on limiting the amount and potential exposure of any activity required within the zone. The critical safety steps to mitigate the hazards associated with working within the Exclusion Zone must be defined in the JSA and potentially other project-specific plans (i.e., critical lift plans, etc.), and approved by the Roux Project Principal and client representative, if required, prior to implementation.

4. TRAINING

Many Roux projects have different requirements that are client-specific or site-specific in nature. It is the responsibility of the Project Principal (or Project Manager if delegated this responsibility by the Project Principal) to ensure that the workers assigned to his/her projects are provided orientation and training with respect to these client and/or site-specific requirements.

APPENDIX G

Incident Investigation and Reporting Management Program

INCIDENT INVESTIGATION AND REPORTING MANAGEMENT PROGRAM

CORPORATE HEALTH AND SAFETY MANAGER	:	**Brian Hobbs, CIH, CSP**
EFFECTIVE DATE	:	**01/19**
REVISION NUMBER	:	**4**

TABLE OF CONTENTS

1. PURPOSE 1

2. SCOPE AND APPLICABILITY 1

3. RESPONSIBILITIES 1
   3.1 Corporate Health and Safety Manager (CHSM) 1
   3.2 Office Manager (OM) 1
   3.3 Office Health and Safety Manager (OHSM) 1
   3.4 Project Manager (PM) 2
   3.5 Site Health and Safety Officer (SHSO) 2
   3.6 All Personnel 2

4. PROCEDURE 2
   4.1 Incident Investigation 2
   4.2 Incident Report 3

Appendix A – Accident Report and Investigation Form 1

Appendix B – Near Loss Form 1

Appendix C – Injury Illness Reporting Flow Chart 1

APPENDICES

Appendix A – Accident Report and Investigation Form

Appendix B – Near Loss Form

Appendix C – Injury Illness Reporting Flow Chart

1. PURPOSE

Roux Associates, Inc. and its affiliated companies, Roux Environmental Engineering and Geology, D.P.C, and Remedial Engineering (collectively, "Roux") has instituted the following management program for reporting Environmental Health and Safety (EHS) incidents and near losses, investigation and correcting the causes of incidents, tracking incidents and corrective actions taken, and sharing the cause and corrective actions with Roux personnel. These practices and procedures establish a method to track progress and improvements to the company EHS performance.

2. SCOPE AND APPLICABILITY

These procedures apply to all Roux employees. Employees are required to follow these procedures for all incidents involving Roux personnel, or other personnel (e.g., subcontractors) working for Roux, regardless of the specific work activity or work location.

This program is intended, in part, to fulfill the Occupational Safety and Health Administration (OSHA) occupational injury and illness reporting and recording requirements cited in the Code of Federal Regulations (CFR) at 29 CFR 1904.

3. RESPONSIBILITIES

It shall be the responsibility of all Roux employees to report all incidents as soon as possible to the PM (or Administrative Manager for office-related incidents), SHSO, OHSM and OM, regardless of severity. Additionally, the following positions have specific responsibilities for implementing this specific SOP.

3.1 Corporate Health and Safety Manager (CHSM)

- The CHSM has the responsibility of ensuring that a system is in place for reporting, investigation, correction, and communicating of EHS incidents and near losses.
- The CHSM has the overall responsibility of implementing and communicating the contents of this program to Office Health and Safety Managers (OHSMs).
- The CHSM will review all incidents and corrective actions taken. The CHSM will provide a summary of serious incidents to the Board of Directors.
- The CHSM will communicate learnings from incidents and corrective actions taken to all personnel, through quarterly communications.
- The CHSM will periodically review and evaluate the effectiveness of this procedure.

3.2 Office Manager (OM)

- The OM will designate the individual to serve as the OHSM responsibility for ensuring that requirements in this procedure are met.
- The OM will ensure that sufficient resources are allocated to fulfill the requirements of this procedure.
- The OM will conduct final review of all incident reports prepared under this procedure.

3.3 Office Health and Safety Manager (OHSM)

- It is the responsibility of the OHSM to review draft incident reports and assist the OM in finalizing reports of all accidents, illnesses and incidents related to work activity, and to assist the SHSO when necessary.

- The OHSM may not approve a site-specific HASP unless the HASP includes incident reporting procedures and forms.
- The OHSM will suggest and implement corrective actions to prevent the same type of incident from re-occurring.
- The OHSM will keep all incident reports, corrective action taken, and follow-up forms on file. The OHSM will provide copies of all final reports and forms to the CHSM within one week of the incident. If a serious incident occurs, the CHSM will be notified as soon as possible.
- The occurrence of a serious incident will trigger an EHS audit by the OHSM.

3.4 Project Manager (PM)

- It shall be the PM's responsibility to promptly correct any deficiencies that were determined to cause or contribute to the incident investigated.
- If a site-specific HASP is not utilized, the PM must ensure that field personnel have copies of the Roux Accident Reporting and Investigation Forms.
- The PM has the responsibility of ensuring that the SHSO and other field personnel understand the need for timely incident reporting.
- In the event of an incident, the PM will determine the root cause of the incident with the assistance of the SHSO and/or OHSM. The PM should provide input as to corrective preventative measures.

3.5 Site Health and Safety Officer (SHSO)

- The SHSO shall provide the details of the incident to the OHSM, PM and OM. The OM or his delegate will provide additional notifications, such as, in the event of a work-related motor vehicle accident, to include Roux Legal.
- It is the SHSO's responsibility to immediately notify the OHSM and the PM when any incident occurs. Such notification should take place immediately following the completion of any emergency actions required by the HASP.
- The SHSO should provide input as to corrective preventative measures.
- The SHSO must ensure that corrective actions proposed by the OHSM or OM are carried out.

3.6 All Personnel

- All personnel are responsible for reporting and describing the details of any incident in which they are involved to the SHSO and PM. Such notification should take place immediately following the completion of any emergency actions required by the HASP and after the loss and before the scene is disturbed or vehicles moved.

4. PROCEDURE

4.1 Incident Investigation

On receiving a report of incident or near loss occurrence from a Roux employee, the SHSO or OHSM shall immediately investigate the circumstances and shall make appropriate recommendations to prevent recurrence. The Incident Report form can be found in **Appendix A**, and Near Loss form can be found in **Appendix B**. The OHSM may participate in the investigation of more serious accidents and incidents that occur on-site. The Corporate Health and Safety Manager (CHSM) shall also be immediately notified by telephone on occurrence of a serious accident or incident. At the CHSM's discretion, he may also participate in the investigation.

4.2 Incident Report

Details of the incident shall be documented using the Accident Report and Investigation Forms (Appendix A) within twenty-four (24) hours of the incident and shall be distributed to the SHSO, the OHSM, PM, OM and the CHSM. The CHSM will update OSHA Forms 301 and the 300 log when necessary.

Appendix A – Accident Report and Investigation Form

☐ Roux Environmental Engineering and Geology, D.P.C.
☐ Roux Associates, Inc. ☐ Remedial Engineering, P.C.

ACCIDENT REPORT

Brian Hobbs, Corporate Health and Safety Manager
Cell: (631) 807-0193; Office: (631) 630-2416

PART 1: ADMINISTRATIVE INFORMATION

Project #: _____
Project Name: _____
Project Location (street address/city/state)**:**
_____
_____
Client Corporate Name / Contact / Address / Phone #:
_____
_____
_____
_____
_____

Immediate Verbal Notifications Given To:

Corporate Health & Safety	☐Yes	☐No
Office Health & Safety	☐Yes	☐No
Office Manager	☐Yes	☐No
Project Principal	☐Yes	☐No
Project Manager	☐Yes	☐No
Client Contact	☐Yes	☐No

REPORT STATUS (time due):
☐ Initial (24 hr) Date: _____
☐ Final (5-10 days) Date: _____

Accident Report Delivered To:

Corporate Health & Safety	☐Yes	☐No
Office Health & Safety	☐Yes	☐No
Office Manager	☐Yes	☐No
Project Principal	☐Yes	☐No
Project Manager	☐Yes	☐No

REPORT TYPE: ☐ Loss ☐ Near Loss Estimated Costs: $ _____

OSHA CASE # Assigned by Corporate Health & Safety if Applicable:

Corporate Health & Safety Confirmed Final Accident Report ☐Yes ☐No

DATE OF INCIDENT: _____

TIME INCIDENT OCCURRED: _____ ☐AM ☐PM

INCIDENT LOCATION – City, State, and Country (If outside U.S.A.) _____

INCIDENT TYPES: (Select most appropriate if Loss occurred.)
From lists below, please select the option that best categories the incident. When selecting an injury or illness, also indicate the severity level.

☐**INJURY** ☐**ILLNESS**

----------**Severity Level**----------

☐Fatality ☐First Aid ☐Medical Treatment
☐Restricted Work ☐Lost Time

OTHER INCIDENT TYPES

☐Spill / Release
Material involved: _____
Quantity (U.S. Gallons): _____

☐Misdirected Waste ☐Consent Order ☐NOV
☐Property Damage ☐Exceedance
☐Motor Vehicle ☐Fine / Penalty

ACTIVITY TYPE (Check most appropriate one.)

☐CAMP	☐Gauging	☐Subsurface Clearance
☐Construction	☐O&M	☐Trucking
☐Drilling	☐Other Soil Work (e.g. Compaction)	☐Waste Mgmt.
☐Driving	☐Sampling	☐Work Area Prep.
☐Excavation / Trenching	☐Site Walk/Inspection	☐Other

INJURY TYPE (Check all applicable.)

☐Abrasion	☐Occupational Illness
☐Amputation	☐Puncture
☐Burn	☐Rash
☐Cold/Heat Stress	☐Repetitive Motion
☐Inflammation	☐Sprain/Strain
☐Laceration	☐Other_____

BODY PART AFFECTED (Check all applicable.)

☐Respiratory	☐Shoulder	☐Face
☐Neck	☐Arm	☐Leg
☐Chest	☐Wrist	☐Knee
☐Abdomen	☐Hand/Fingers	☐Ankle
☐Groin	☐Eye	☐Foot/Toes
☐Back	☐Head	☐Other_____

I. PERSON(S) DIRECTLY / INDIRECTLY INVOLVED IN INCIDENT (Attach additional information as necessary/applicable.)

Name/Phone # of Each Person Directly/Indirectly Involved in Incident:	Designate: Roux/Remedial Employee Roux/Remedial Subcontractor Client Employee Client Contractor Third Party	As applicable, Current Occupation; Yrs in Current Occupation; Current Position; and Yrs in Current Position:	As applicable, Employer Name; Address; and Phone #:	As applicable, Supervisor Name; and Phone #:
1)				
2)				

II. PERSONS INJURED IN INCIDENT (Attach additional information as necessary/applicable.)

Name/Phone # of Each Person Injured in Incident:	Designate: Roux/Remedial Employee Roux/Remedial Subcontractor Client Employee Client Contractor Third Party	As applicable, Current Occupation; Yrs in Current Occupation; Current Position; and Yrs in Current Position:	As applicable, Employer Name; Address; and Phone #:	As applicable, Supervisor Name; and Phone #:	Description of Injury:
1)					
2)					

III. PROPERTY DAMAGED IN INCIDENT (Attach additional information as necessary/applicable.)

Property Damaged:	Property Location:	Owner Name, Address & Phone #:	Description of Damage:	Estimated Cost:
1)				
2)				$

IV. WITNESSES TO INCIDENT (Attach additional information as necessary/applicable.)

Witness Name:	Address:	Phone #:
1)		
2)		

PART 2: WHAT HAPPENED AND INCIDENT DETAILS

PROVIDE FACTUAL DESCRIPTION OF INCIDENT (e.g., describe loss/near loss, injury, response / treatment).

I. AUTHORITIES/GOVERNMENTAL AGENCIES NOTIFIED (Attach additional information as necessary/applicable.)

Authority/Agency Notified:	Name/Phone #/Fax # of Person Notified:	Address of Person Notified:	Date & Time of Notification:	Exact Information Reported/Provided:

II. PUBLIC RESPONSES TO INCIDENT (if applicable)

Response/Inquiry By: (check one)	Entity Name:	Name/Phone # of Respondent/ Inquirer:	Address of Entity/Person:	Date & Time of Response/Inquiry:
☐Newspaper ☐Television ☐Community Group ☐Neighbors ☐Other _____				

Describe Response/Inquiry:

Roux/Remedial Response:

(Check all that apply.) (Attach photos, drawings, etc. to help illustrate the incident.)
ATTACHED INFORMATION: ☐Photo ☐Sketches ☐Vehicle Acord Form ☐Police Report ☐Other

Name(s) of person(s) who prepared Initial and Final Report:	**Title(s):**	**Phone number(s):**

PART 3: INVESTIGATION TEAM ANALYSIS

Date Investigation Started (MM/DD/YYYY):

Factors, Root Causes, and Solution (FRCS): Complete FRCS form and answer all 7 factor questions. If answering NO to Factors 1 – 4 identify root cause(s) and explain why QIs) occurred. If answering YES to Factors 5 – 7 circle the root cause(s). Transfer the solutions guidance that addresses each root cause from the FRCS form to this form. Attach your completed FRCS Worksheet. If Factors 1-7 do not apply to the incident, write "External Cause" in the Factor column below and leave the remaining fields blank.

DESCRIPTION OF UNDESIRABLE BEHAVIOR/CONDITION

1.

2.

FACTOR(S) AND SOLUTION(S): HOW TO REDUCE POSSIBILITY OF INCIDENT RECURRING
Selection of factors and solutions reflects the analysis of investigation team and is not meant to be a legally binding conclusion as to the Root Cause and/or solution.

CAUSAL FACTOR/ BEHAVIOR/ CONDITION	ROOT CAUSE	SOLUTION(S) [Must Match Root Cause(s)]	PERSON RESPONSIBLE	AGREED DUE DATE	ACTUAL COMPLETION DATE

INVESTIGATION TEAM:

PRINT NAME	JOB POSITION	DATE	SIGNATURE

QUALITY REVIEW Correct root cause(s) identified? Do root cause(s) and solution(s) match? Are solution(s) feasible / maintainable?

Name: **Job Title:**

PART 4: Date Solutions were Implemented & Validated (Were Solutions Effective?)

Date	Solution	Verifier / Validator Name and Job Title	**Details** (of I & V performed)

Appendix B – Near Loss Form

HEALTH & SAFETY NEAR LOSS
ROUX REPORT FORM

☐ **Roux Environmental Engineering and Geology, D.P.C.**
☐ **Roux Associates, Inc.** ☐ **Remedial Engineering, P.C.**

(Check applicable company name)

PART 1: ADMINISTRATIVE INFORMATION

Office: ☐ New York ☐ Massachusetts ☐ New Jersey ☐ Illinois ☐ CA - Los Angeles ☐ CA - Oakland

Project Manager:	**Project Principal:**
Project Name:	**Project Location:**

PART 2: NEAR LOSS INCIDENT DETAILS

Date\Time Occurred (MM/DD/YYYY HH:MM)**:**	**Date\Time Submitted** (MM/DD/YYYY HH:MM)**:**

NEAR LOSS INCIDENT TYPE - What could have happened? - Select all that apply (1-7)

1. ☐ Fire / Explosion
2. ☐ Injury / Illness
3. ☐ Security (e.g., theft, trespassing, vandalism)
4. ☐ Environmental (Spill, permit exceedance, etc.)
5. ☐ Transportation of personnel (vehicle accident)
6. ☐ Property/Equipment Damage
7. ☐ Business Interruption

Event Leading to Potential Injury/Illness:

Job Task*:	**Equipment Involved*:**

WHAT HAPPENED? Do not include individuals' names. Ensure photos, sketches, etc. are not personally identifiable unless written consent has been obtained.

Summary (1-2 sentences. Provide brief description of the incident. Provide facts only, no speculation or opinion)**:**

Incident Details (Brief factual details of what, where, when; include photos, sketches, etc. as attachments)**:**

Immediate Corrective Actions Taken:

SERIOUS INJURY OR FATALITY (SIF): IF AN ACTUAL SIF, USE EXISTING ROUX ACCIDENT REPORTING FORM

Could this have resulted in a SIF? ☐ **Yes** ☐ **No**

A potential SIF is defined as likely to have caused an injury resulting in significant physical body damage with probable long term and/or life altering complications.

INCIDENT INVOLVED:

Roux Employee: ☐ **Yes** ☐ **No** **Subcontractor Company Name:**

INVESTIGATION TEAM

NAME	JOB TITLE	NAME	JOB TITLE

PART 3: INCIDENT INVESTIGATION FINDINGS AND REPORT QUALITY REVIEW

Date Investigation Started (mm/dd/yyyy):

Factors, Root Causes, and Solution (FRCS): Complete FRCS form and answer all 7 factor questions. If answering NO to Factors 1 – 4 identify root cause(s) and explain why QIs) occurred. If answering YES to Factors 5 – 7 circle the root cause(s). Transfer the solutions guidance that addresses each root cause from the FRCS form to this form. Attach your completed FRCS Worksheet. If Factors 1-7 do not apply to the incident, write "External Cause" in the Factor column below and leave the remaining fields blank. Do not include individuals' names.

DESCRIPTION OF UNDESIRABLE BEHAVIOR/CONDITION

1.

2.

FACTOR(S) AND SOLUTION(S): HOW TO REDUCE POSSIBILITY OF INCIDENT RECURRING
Selection of factors and solutions reflects the analysis of investigation team and is not meant to be a legally binding conclusion as to the Root Cause and/or solution.

Behavior / Condition	Root Cause	Solution(s) (Must Match Root Cause)	Person Responsible for Completion	Completion Target Date	Completion Actual Date

QUALITY REVIEW Correct root cause(s) identified? Do root cause(s) and solution(s) match? Are solution(s) feasible / maintainable?

Name: **Job Title:**

PART 4: Date Solutions were Implemented & Validated (Were Solutions Effective?)

Date	Solution	Verifier / Validator Name and Job Title	**Details** (of I & V performed)

***JOB TASK - Select the most appropriate one** (primary job associated with incident-related work activity, avoid "Other" if possible)

1. CAMP
2. Construction
3. Drilling
4. Driving
5. Excavation/Trenching
6. Gauging
7. O&M
8. Other Soil Work (e.g. Compaction)
9. Sampling
10. Site Walk/ Inspection
11. Subsurface Clearance
12. Trucking
13. Waste Management
14. Work Area Preparation
15. Other

***EQUIPMENT INVOLVED THAT CONTRIBUTED TO H&S NEAR LOSS - Select all that apply**

1. Air Stripper
2. API Separator
3. Automobile
4. Boom Material
5. Bulldozer
6. Cable
7. Carbon Drum / Vessel
8. Chain Block
9. Compressor, Air
10. Control Panel (local)
11. Crane (mobile)
12. Drill Rig
13. Drilling Equipment, Vacuum
14. Drum, Vertical
15. Dump Truck
16. Electric Heater
17. Electrical Power Supply
18. Engine, Combustion
19. Equipment Safety Grounding
20. Excavator / Power Shovel
21. Exclusion Zone Equipment
22 Fan / Blower
23 Fencing
24 Filter
25. Fire Extinguisher
26. Forklift
27. Front End Loader
28. Grader
29. Hammer
30. Knife
31. Non-Powered Equipment
32. Powered Equipment
33. Drill
34. Grinder
35. Hydraulic Torque Wrench
36. Powered Saw
37. Impact Wrench
38. Saw
39. Screwdriver
40. Shears
41. Shovel
42. Snip
43. Wrench
44. Hoist
45, Hook/Clamp/Buckle, etc.
46. Jack
47. Ladder, Extension
48. Ladder, Platform
49. Ladder, Step
50. Lock Out / Tag Out
51. Maintenance Tool, General
52. Manifold
53, Manlift/Basket/Cherry Picker
54. Motor, Electric
55. Oxidizer
56. Pallet
57. Piping
58. Piping, Hose
59. Piping, Injection/Mixing Point
60. Hydrojet
61. Centrifugal Pump
62. Diaphragm Pump
63. Reciprocating Pump
64. Regenerative Pump
65. Rotary Pump
66. Transfer Pump
67. Submersible Pump
68. Face Shield
69. Fall Protection
70. Gloves
71. Hard Hat / Helmet
72. Hearing Protection
73. Respiratory PPE (Chemical)
74. Respiratory PPE (Particulate)
75. Safety Glasses
76. Safety Goggles
77. Safety Shoes / Boots
78. Safety Vest / Clothing
79. Rope
80. Bailer
81. Geoprobe
82. Hand Auger
83. PID
84. Multi-Gas Meter
85. Sample Container
86. Split-Spoon Sampler
87. Sling
88. Snow Blower
89. Snow Plow
90. Space Heater
91. Air Sparging System
92. Carbon Treatment Sys
93. Chemical Oxidation S
94. Dual Phase Product Recovery System
95. Groundwater Pump and Treat System
96. POET System
97. Shed or Trailer
98. Vapor Extraction System
99. Vapor-Phase Treatment System
100. Other System, Type:___
101. Surge Tank
102. Underground Tank
103. Telemetry System
104. Testing Devices
105. Tractor Trailer
106. Truck, Flatbed
107. Truck, Pickup
108. Truck, Tank Truck
109. Truck, Vacuum
110. Safety Valve
111. Block Valve
112. Extraction Well
113. Monitoring Well
114. Recovery Well
115. Winch
116. Wire Rope
117. No Equipment Involved
118. MPT – Traffic Control Devices
118. Not in List (describe):___

Appendix C – Injury Illness Reporting Flow Chart

Health & Safety Near/Loss – Loss (Incident)*
Notification Flow Chart

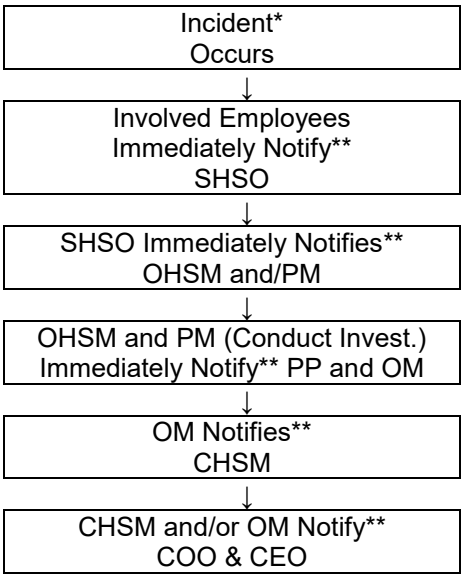

* Incident – any work or site-related occurrence that resulted in, or could potentially have resulted in, the need for medical care or in property damage (i.e., all injuries or illnesses, exposure to toxic materials or any other significant occurrence resulting in property damage or in a "near loss")

** Verbal Notification

Initial Incident Report (written) to SHSO, OHSM, OM and CHSM within 24 hours
Follow-up Report within one week.