Groundwater Sampling Work Plan (GWS WP)

1360 East Main Street,
Shrub Oak, New York

July 15, 2026

Prepared for:

Shrub Oak Partners, LLC

Prepared by:

Roux Environmental Engineering and Geology, D.P.C.
209 Shafter Street
Islandia, New York 11749

3950.0001Y132/CV

Environmental Consulting
& Management
+1.800.322.ROUX
rouxinc.com

Table of Contents

Certification ii

1. Introduction 1

2. Scope of Work 2
   2.1 Additional Groundwater Sampling 2
      2.1.1 Site Well Inspection and Gauge 2
      2.1.2 Groundwater Sampling 2

3. Reporting 3

4. GWS Work Plan Implementation Schedule 4

Tables

1. Monitoring Well Information and Sampling Plan

Figures

1. Site Location Map

2. Proposed Sampling Point Location Map

Appendices

A. Well Inspection Checklist

B. Well Construction Logs

C. Groundwater Sampling Logs

D. Site-Specific Health and Safety Plan

Certification

I, Paul Martorano, P.E., certify that I am currently a Qualified Environmental Professional as defined in 6 NYCRR Part 375 and that this Groundwater Sampling Work Plan was prepared in accordance with all applicable statutes and regulations and in substantial conformance with the DER Technical Guidance for Site Investigation and Remediation (DER-10).

Paul Martorano, P.E.	July 15, 2026	
NYS Professional Engineer #088403	Date	Signature

1. Introduction

Roux Environmental Engineering and Geology, D.P.C. (Roux) on behalf of Shrub Oak Partners, LLC (the "Participant"), has prepared this Groundwater Sampling Work Plan (GWS WP) for the Mr. Cleaners – Shrub Oak Shopping Center Site (NYSDEC Brownfield Cleanup Program Site No. C360117), located at 1360 East Main Street, Shrub Oak, New York (Site). The Site was accepted into the Brownfield Cleanup Program Site (BCP) under Site Code #C360117. The Brownfield Cleanup Agreement (BCA) was executed on January 27, 2014 (Index # C360117-11-13).

The Site is approximately 3.47 acres and comprised of a one-story building and an asphalt paved parking lot. The footprint of the building is approximately 46,586 square feet and contains eight tenant spaces. The eight tenant spaces are occupied by an ACME Store #2830, a dry cleaner, a pizzeria, a United States Postal Service office, a Wells Fargo bank, a laundromat, a nail salon, and a vacant space that was formerly a Chase bank. A figure showing the site location and boundaries of the Site is provided in Figure 1.

On February 19, 2026, the New York State Department of Environmental Conservation (NYSDEC) in consultation with the New York State Department of Health (NYSDOH), issued letters of disapproval for the Remedial Investigation Report (RIR) and Construction Completion Report (CCR) submitted in May of 2025. The disapproval letters identified additional data needs and/or project clarifications related to the groundwater and soil vapor intrusion pathway and the effectiveness of the existing sub-slab depressurization systems (SSDS).

This GWS WP has been prepared to address the NYSDEC/NYSDOH comments concerning groundwater conditions related to Chlorinated Volatile Organic Compounds (CVOC) contamination associated with the former dry-cleaning operations. The work described herein will be performed in general accordance with NYSDEC DER-10.

2. Scope of Work

The objective of the proposed GWS WP is to further evaluate the extent of dry cleaner-related impacts and assess current CVOC concentrations within existing on-site and off-site groundwater monitoring wells.

Quality assurance/quality control (QA/QC) samples will be collected during GWS to ensure that suitable and verifiable data results from sampling and analyses are performed. All data will be produced in accordance with NYSDEC Analytical Services Protocol (ASP) Category B deliverables and will be reviewed by a qualified data validator independent from the Project. A Data Usability Summary Report (DUSR) will be prepared before data is incorporated into the RIR for the Site. All data will be submitted to NYSDEC in electronic format, in accordance with DER-10, Section 1.15.

2.1 Additional Groundwater Sampling

2.1.1 Site Well Inspection and Gauge

Prior to sampling, all wells will be gauged and inspected to ensure that the well is free from damage, and to determine any conditions that may affect data viability. The gauging data and well conditions will be recorded on well inspection forms included in **Appendix A**. Sampling points proposed for sampling under this GWS Work Plan are provided in **Table 1**. Locations of the sampling points are presented in **Figure 2**. Well construction logs are provided in **Appendix B.**

2.1.2 Groundwater Sampling

Groundwater samples will be collected using low-flow methods described in the USEPA guidance document titled, “Ground Water Sampling Procedure, Low Stress (Low Flow) Purging and Sampling” (USEPA, 2010). During purging, a water quality meter will be used to monitor water quality parameters such as pH, dissolved oxygen, conductivity, temperature, turbidity, and oxidation reduction potential (ORP). The field parameters will be recorded on groundwater sampling logs included in **Appendix C**.

Groundwater samples will be analyzed for Target Compound Lists (TCL) Volatile Organic Compounds (VOCs) via United States Environmental Protection Agency (USEPA) Method 8260D.

All groundwater samples will be placed in the appropriate preserved containers, placed in ice-filled coolers, and transmitted under chain-of-custody procedures to Pace Laboratories, a NYSDOH Environmental Laboratory Accredited Program (ELAP)-approved laboratory.

All excess purge water generated from groundwater sampling activities by Roux will be containerized in labeled 55-gallon drums and temporarily staged on-Site pending proper characterization and disposal at an appropriate facility. A Site-Specific Health and Safety Plan has been included in **Appendix D**.

3. Reporting

Following receipt of the laboratory analytical reports, the analytical results from the groundwater sampling event will be compared to NYSDEC Ambient Water Quality Standards and Guidance Values (AWQSGVs) for Class GA groundwater. A groundwater contour map including spider-diagrams depicting exceedances of the AWQSGVs (TOGS 1.1.1) will be prepared.

Data gathered during the implementation of the GWS WP that includes, but is not limited to, groundwater analytical data, groundwater gauging data, and recommended actions will be used to determine the need for any new monitoring wells and to subsequently update the RIR, and develop the RAWP.

4. GWS Work Plan Implementation Schedule

The execution of this Work Plan is anticipated to begin in July 2026. On-site sampling will take 1 day to complete.

Scope of Work	Approximate Start Date
Submit Groundwater Sampling Work Plan (GWS WP)	July 3, 2026
Implementation of GWS WP (2-days field work) – tentative, pending approval	July 22 and 23, 2026
Meeting with NYSDEC, NYSDOH, and Roux to discuss data and potential remedial approach	August 2026
Draft and re-submit revised Remedial Investigation Report	August 2026

TABLES


1. Monitoring Well Information and Sampling Plan

Table 1. Monitoring Well Information and Sampling Plan, 1360 East Main Street, Shrub Oak, NY


Sample ID	Installation Date	Location	Well Diameter (inches)	Well Screen Interval (inches)	Scope of Work
MW-1	4/6/2012	Parking Lot	2	16-26	Collect a low-flow GW sample for VOCs analysis
MW-2	4/3/2012	Parking Lot	2	25-45	Collect a low-flow GW sample for VOCs analysis
MW-3	4/3/2012	Parking Lot	2	22-52	Collect a low-flow GW sample for VOCs analysis
MW-4	4/4/2012	Parking Lot	2	13-28	Collect a low-flow GW sample for VOCs analysis
MW-6	4/5/2012	Parking Lot	2	15-25	Collect a low-flow GW sample for VOCs analysis
MW-7	12/8/2015	Parking Lot	2	31.5-36.5	Collect a low-flow GW sample for VOCs analysis
MW-8	12/9/2015	Parking Lot	2	35-40	Collect a low-flow GW sample for VOCs analysis
MW-9	12/8/2015	Sidewalk	2	35-40	Collect a low-flow GW sample for VOCs analysis
MW-11	12/9/2015	Parking Lot	2	22.5-27.5	Collect a low-flow GW sample for VOCs

FIGURES

1. Site Location Map
2. Proposed Sampling Point Location Map

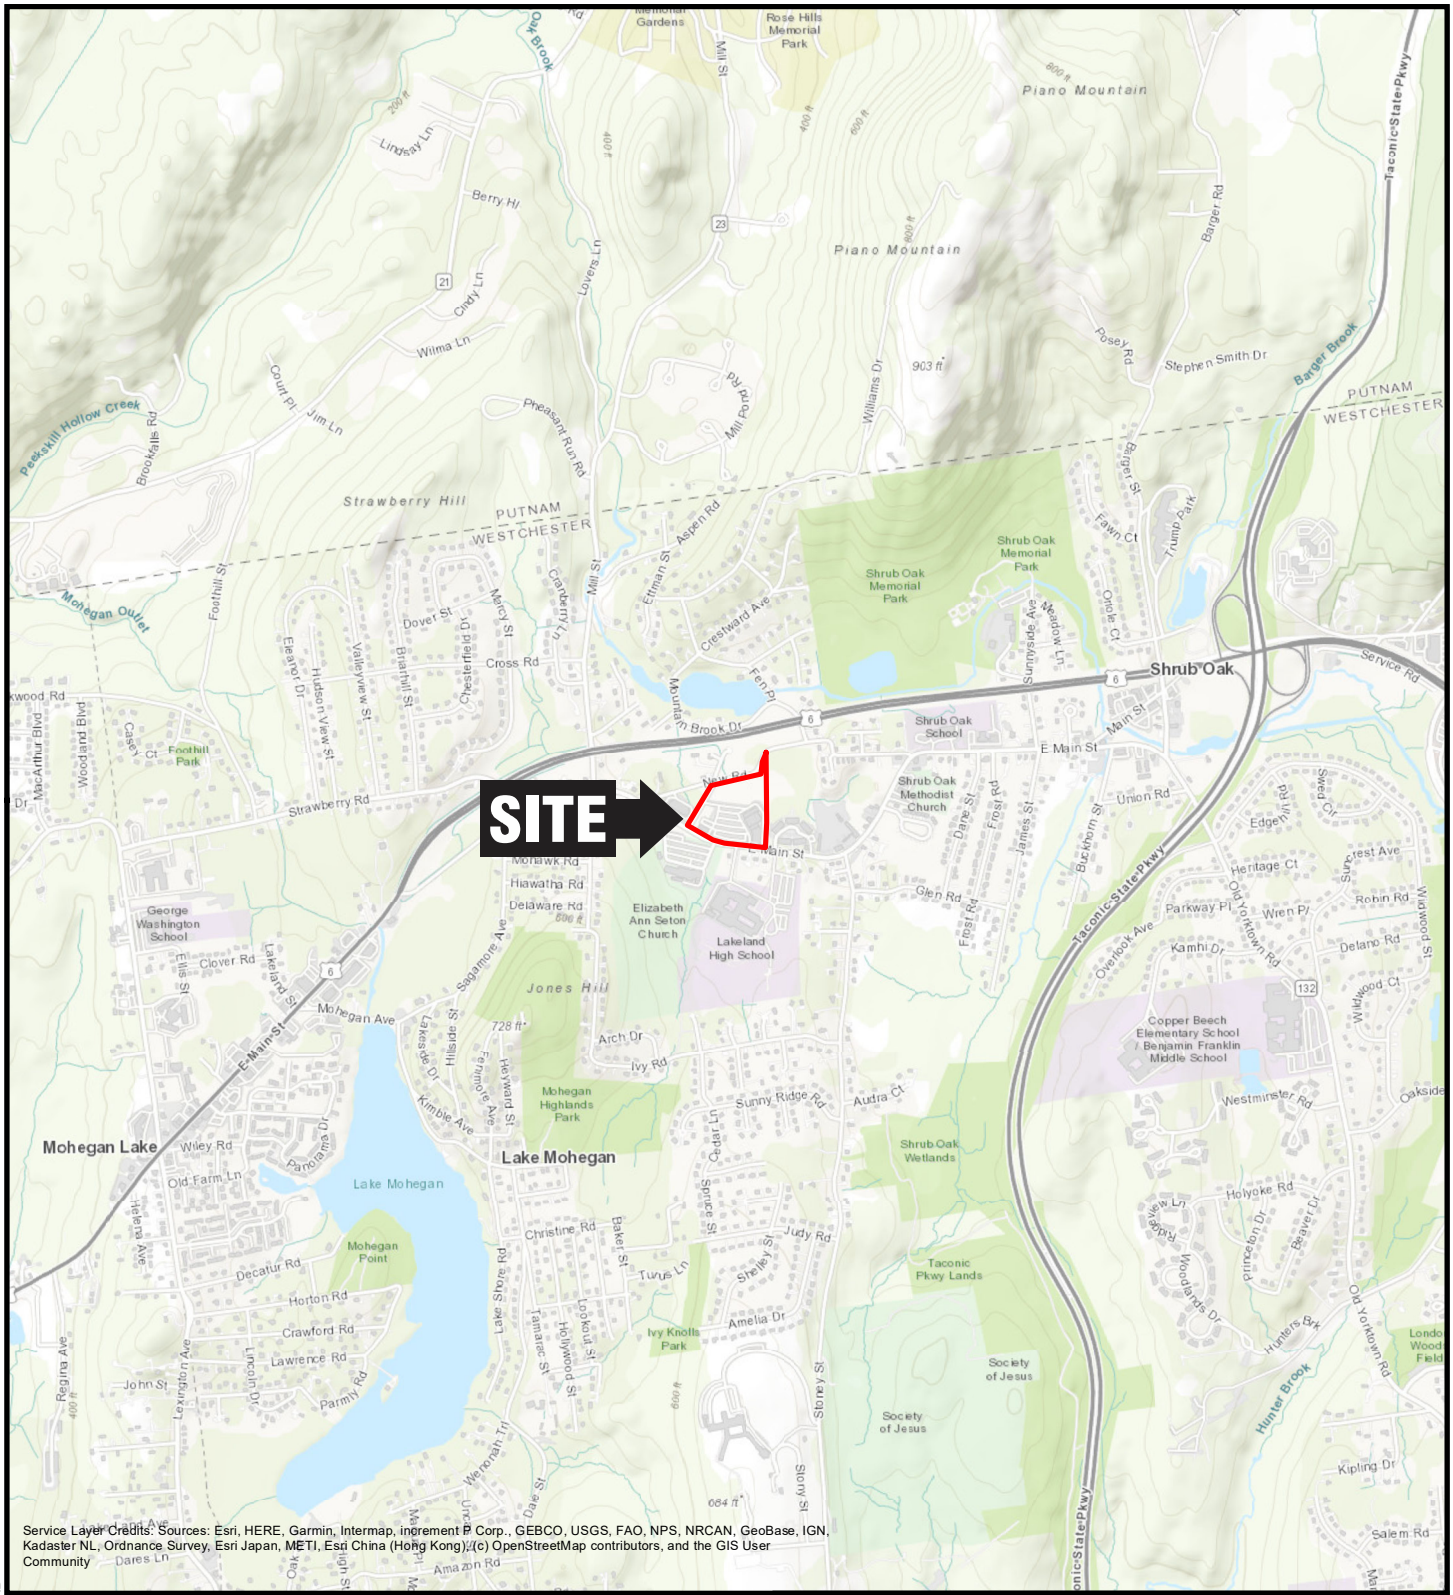

QUADRANGLE LOCATION

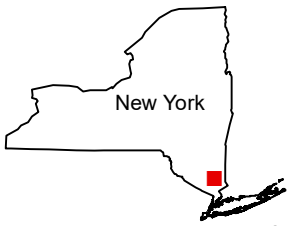

N

2,000 0 2,000'

Title:

SITE LOCATION MAP

REMEDIAL INVESTIGATION REPORT
NYSDEC BCP SITE NO. C360117
MR. CLEANERS - SHRUB OAK SHOPPING CENTER
1360 EAST MAIN STREET, SHRUB OAK, NEW YORK

Prepared for:


SHRUB OAK PARTNERS LLC

ROUX

Compiled by: P.M.	Date: 03/20/25
Prepared by: M.S.R.	Scale: AS SHOWN
Project Mgr: P.M.	Project: 3950.0001Y000
File: 3950.0001Y106.1.mxd	

FIGURE 1

V:\GIS\PROJECTS\3950\0001Y\106\3950.0001Y106.1.MXD

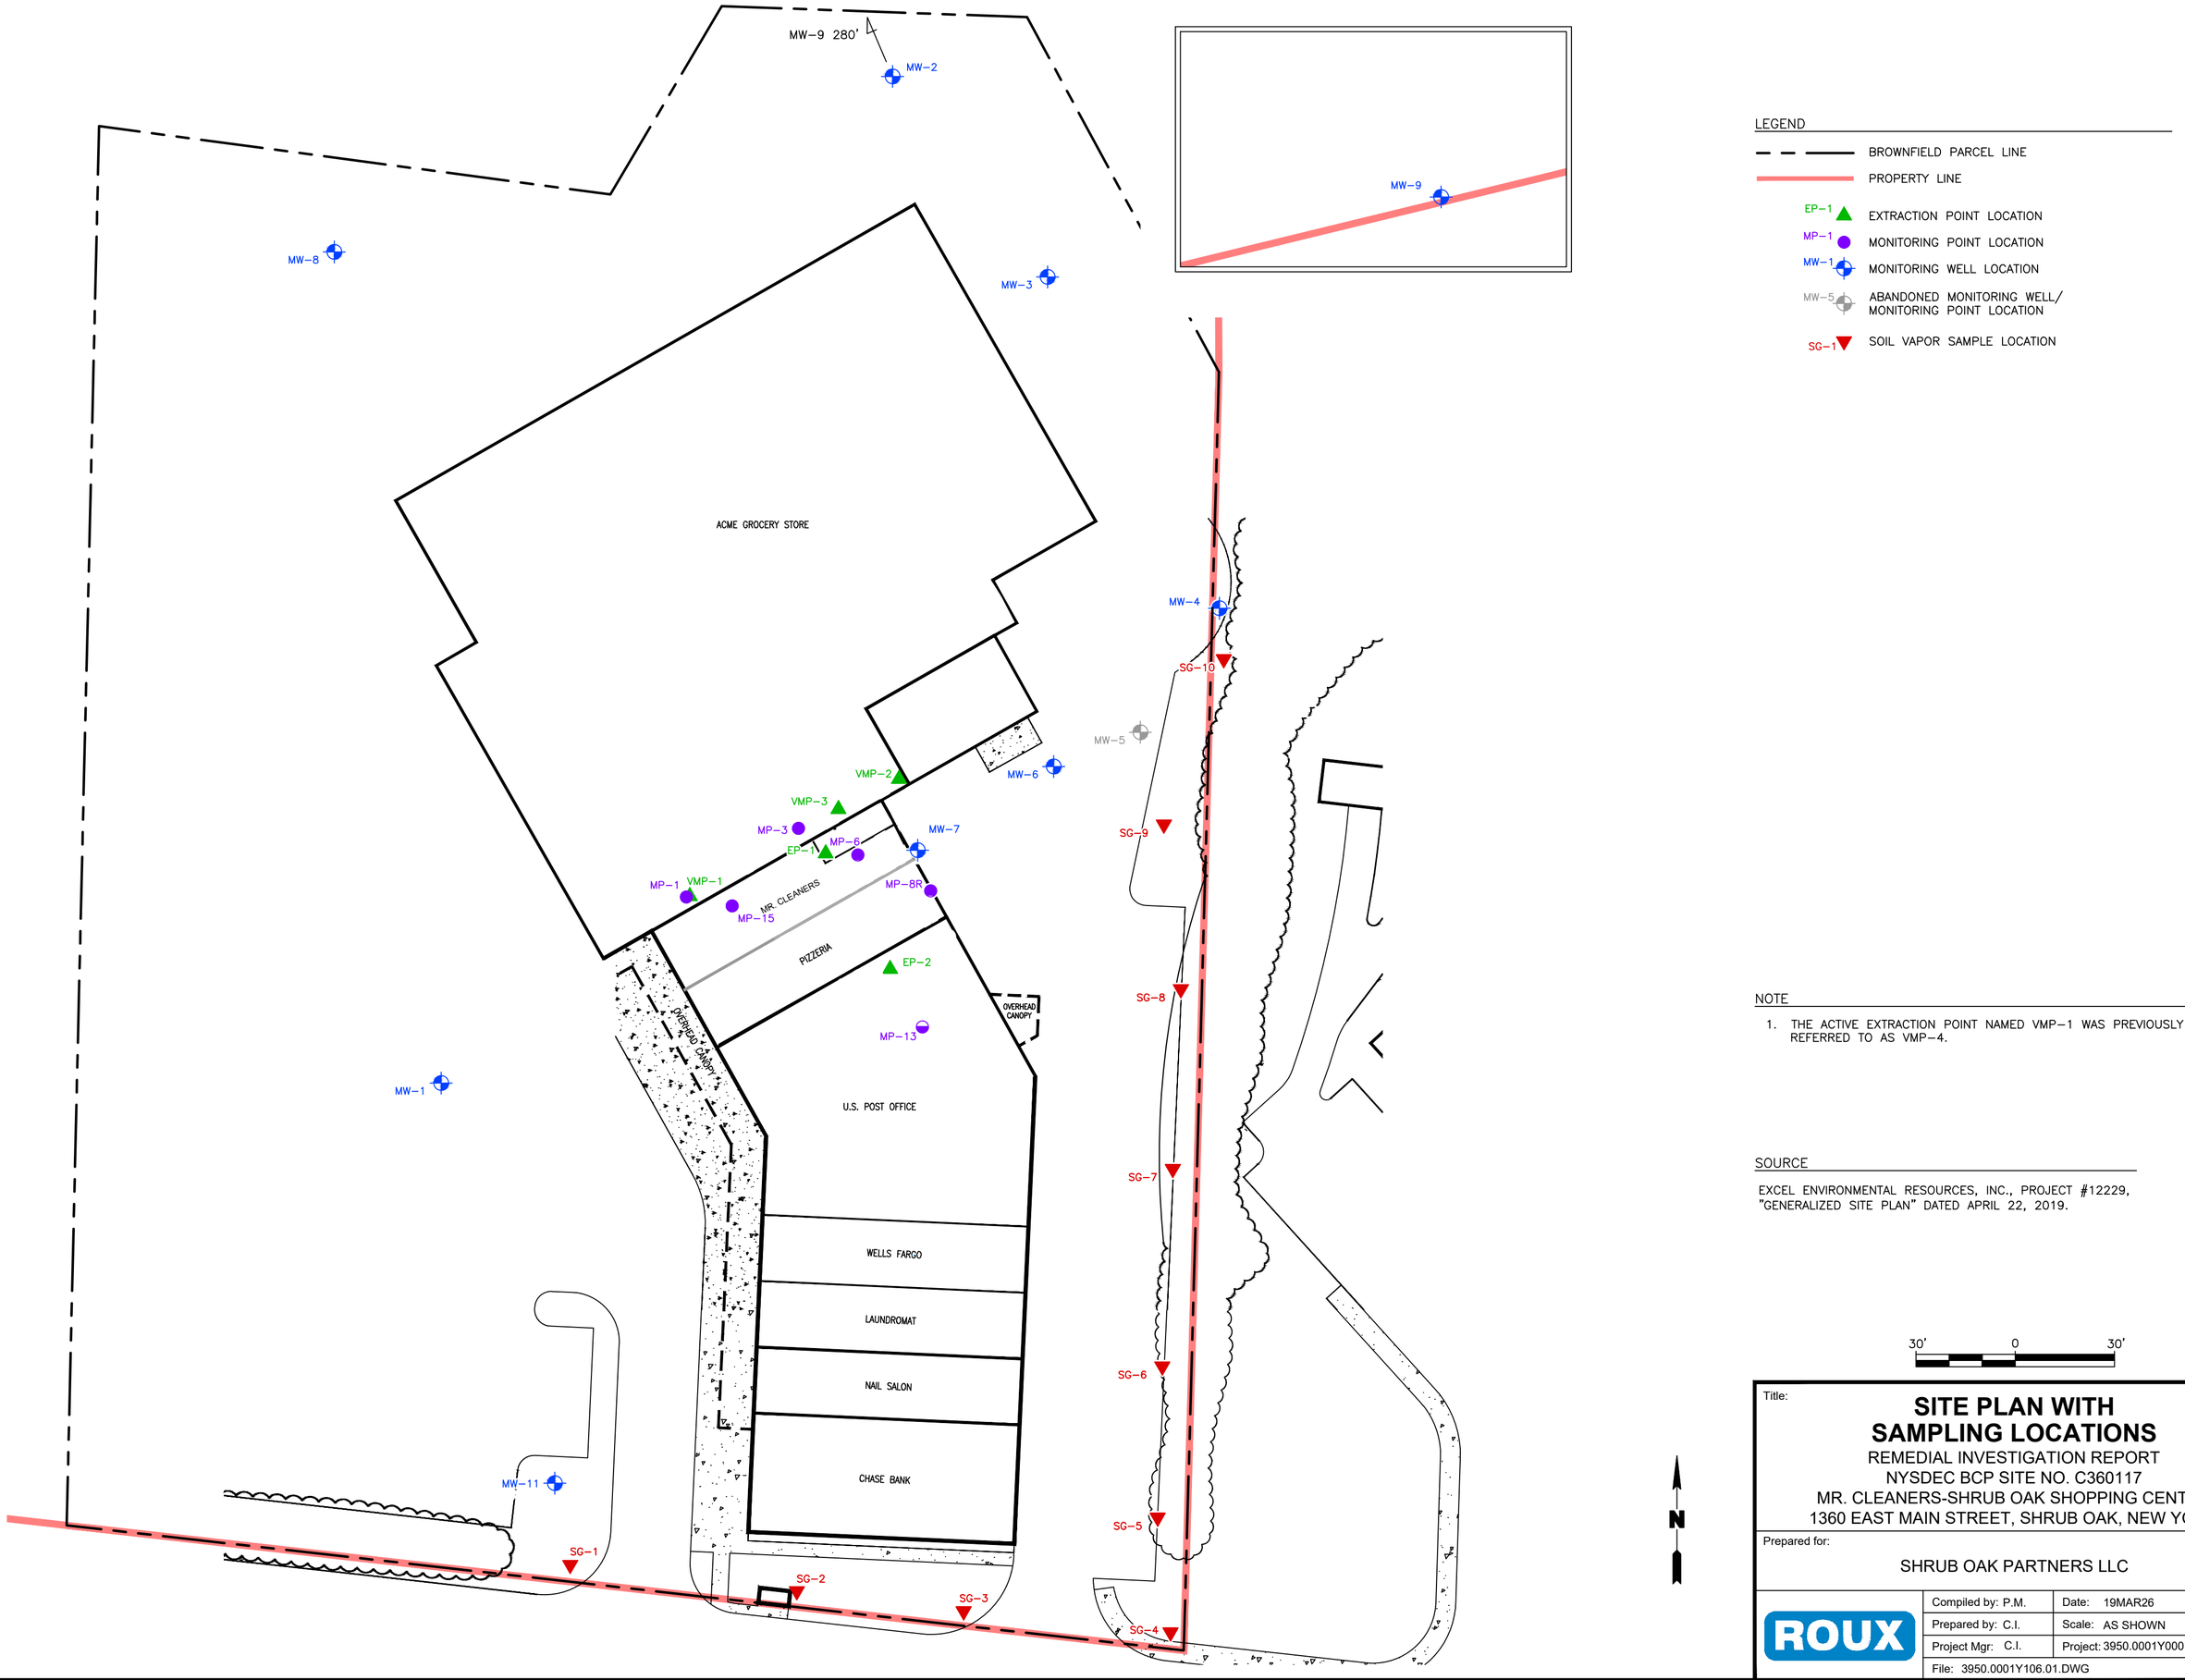

Title:

SITE PLAN WITH SAMPLING LOCATIONS

REMEDIAL INVESTIGATION REPORT
NYSDEC BCP SITE NO. C360117
MR. CLEANERS-SHRUB OAK SHOPPING CENTER
1360 EAST MAIN STREET, SHRUB OAK, NEW YORK

Prepared for:

SHRUB OAK PARTNERS LLC

ROUX

Compiled by: P.M.	Date: 19MAR26	FIGURE
Prepared by: C.I.	Scale: AS SHOWN	2
Project Mgr: C.I.	Project: 3950.0001Y000	
File: 3950.0001Y106.01.DWG		

V:\CAD\PROJECTS\3950\Y000\1Y106\3950.0001Y106.01.DWG

APPENDICES

A. Well Inspection Checklist

B. Well Construction Logs

C. Groundwater Sampling Logs

D. Site-Specific Health and Safety Plan

APPENDIX A

Well Inspection Checklist

WELL INSPECTION CHECKLIST

WELL No. _____ **DATE:** _____

CHECKLIST FOR INSPECTION OF OUTSIDE OF EXISTING WELLS

WEATHER CONDITIONS: _____

AIR TEMPERATURE: _____

	Yes	No	Remarks
1. CEMENT SEAL			
Intact:			
Cracked:			
Missing:			
2. PONDING OF WATER AROUND CEMENT SEAL:			
3. PROTECTIVE STEEL PIPE AND LOCK (If Used)			
Pipe - Intact:			
Lock - Intact:			
4. PVC CASING (Stick-Up) STRAIGHT:			
5. DESIGNATED LEVELING POINT CLEARLY MARKED:			
6. WELL IS PROTECTED:			
7. WELL IS CLEARLY MARKED:			

CHECKLIST FOR INSPECTION OF INSIDE OF EXISTING WELLS

1. %lel: _____
2. PID (PPM): _____
3. DEPTH TO WATER FROM TOP OF PVC: _____
4. DEPTH TO BOTTOM FROM TOP OF PVC: _____

APPENDIX B

Well Construction Logs

HRP Engineering, P.C.
Monitoring Well Installation Log

WELL NO: HRP-MW-1

PROJECT: Mr. Cleaners	**SCREEN SIZE & TYPE:** Continuous wrap PVC 2 inch
JOB NUMBER: NEW9628.p2	**SLOT NO.:** 10 **SETTING:** 16 to 26 ftbg
DATE COMPLETED: 4/6/12	**SAND PACK SIZE & TYPE:** 00
DRILLING COMPANY: Geologic	**SETTING:** 14 to 26 ftbg
RIG TYPE: Hollow Stem Auger	**CASING SIZE & TYPE:** 2 inch schedule 40 PVC
DRILLING METHOD: Hollow Stem Auger	**SETTING:** 0.5 to 16 ftbg
HAMMER WEIGHT/DROP: 140	**SEAL TYPE:** Bentonite pellets
SAMPLING METHOD: Split Spoon	**SETTING:** 11.5 to 14 ftbg
OBSERVER: Mark Wright	**BACKFILL TYPE:** Portland cement
REFERENCE POINT (RP): Grade	**STATIC WATER LEVEL:** 19 ftbg
STICK-UP: None	**GPS COORDINATES: N:**
SURFACE COMPLETION: Flush-mounted curb-box	**W:**

REMARKS: Asphalt 0.5’ thick

ABBREVIATIONS: SS = split spoon W = wash C = cuttings G = grab ST = shelby tube REC = recovery PPM = parts per million

DEPTH (FEET) FROM	DEPTH (FEET) TO	SAMPLE TYPE	BLOW COUNT	REC. (FEET)	MOISTURE	DESCRIPTION	PID READING (PPM)
0.5	2	SS	11-17-16	1.1	Moist	SAND, medium to fine; little gravel; dark brown; medium compact; no odor or staining.	0.0
2	4	SS	16-20-17-14	1.7	Moist	SAND, medium to fine; little gravel; dark brown; compact; no odor or staining.	0.0
4	6	SS	8-24-16-12	1.6	Moist	SAND, Medium to fine; some silt; little gravel; brown; compact; no odor or staining.	0.0
6	8	SS	21-16-17-16	2.0	Moist	Fine SAND and SILT; little coarse sand; brown; compact; no odor or staining.	0.0
8	10	SS	8-8-12-14	1.7	Moist	SAND, fine; some silt; trace coarse sand; brown; compact; no odor or staining	0.0
10	12	SS	22-50/0.2	0.6	Dry	SAND, fine; little coarse sand; trace silt; brown; compact; no odor or staining.	0.2
12	14	SS	9-9-6-8	0.7	Dry	SAND; fine, some coarse gravel; some cobbles; brown; loose; no odor or staining.	0.0

PROJECT: Mr. Cleaners	JOB NUMBER: NEW9628.p2
WELL NO.: HRP-MW-1	PAGE 2 OF 2

DEPTH (FEET)		SAMPLE TYPE	BLOW COUNT	REC. (FEET)	MOISTURE	DESCRIPTION	PID READING (PPM)
FROM	TO						
14	16	SS	7-16-7-10	0.3	Dry	SAND; fine, some coarse gravel; some cobbles; brown; loose; no odor or staining.	0.0
16	18	SS	10-10-11-12	1.3	Dry	SAND, medium to fine; little gravel; trace silt; brown; loose; no odor or staining.	8.5
18	20	SS	11-7-6-8	1.2	Wet @ 19’	SAND, fine; some coarse sand; brown; loose; no odor or staining.	11.1
20	22	SS	6-6-6-7	0.4	Wet	Fine to coarse SAND and GRAVEL; brown; loose; no odor or staining.	0.0
22	24	SS	7-7-7-5	1.1	Wet	Fine to coarse SAND and GRAVEL; brown; loose; no odor or staining.	0.0
24	26	SS	4-8-10-12	0.8	Wet	Fine to coarse SAND and GRAVEL; brown; loose; no odor or staining.	0.0
	26					End of boring.	

	HRP Engineering, P.C. Monitoring Well Installation Log	**WELL NO:** HRP-MW-2 **PAGE** 1 **OF** 2 **PAGES**

PROJECT: Mr. Cleaners	**SCREEN SIZE & TYPE:** Continuous wrap PVC 2 inch
JOB NUMBER: NEW9628.p2	**SLOT NO.:** 10 **SETTING:** 25 to 45 ftbg
DATE COMPLETED: 4/3/12	**SAND PACK SIZE & TYPE:** 00
DRILLING COMPANY: Geologic	**SETTING:** 24 to 45 ftbg
RIG TYPE: Hollow Stem Auger	**CASING SIZE & TYPE:** 2 inch schedule 40 PVC
DRILLING METHOD: Hollow Stem Auger	**SETTING:** 0.5 to 25 ftbg
HAMMER WEIGHT/DROP: 140	**SEAL TYPE:** Bentonite pellets
SAMPLING METHOD: Split Spoon	**SETTING:** 24 to 14 ftbg
OBSERVER: James Charter	**BACKFILL TYPE:** Portland cement
REFERENCE POINT (RP): Grade	**STATIC WATER LEVEL:** 10 ftbg
STICK-UP: None	**GPS COORDINATES: N:**
SURFACE COMPLETION: Flush-mounted curb-box	**W:**
REMARKS: Asphalt 0.5' thick	
ABBREVIATIONS: SS = split spoon W = wash C = cuttings G = grab ST = shelby tube REC = recovery PPM = parts per million	

DEPTH (FEET)		SAMPLE TYPE	BLOW COUNT	REC. (FEET)	MOISTURE	DESCRIPTION	PID READING (PPM)
FROM	TO						
0.5	2	SS	16-11-12	0.9	Moist	SAND, coarse to fine; some coarse to fine gravel; little silt; brown; loose ; no staining or odor	0.0
2	4	SS	9-6-12-9	1.41	Moist	SAND, coarse to fine; little coarse to fine gravel; little silt; grey; loose; no odor or staining.	0.0
4	6	SS	3-3-2-3	1.9	Moist	SAND, coarse to fine; little coarse to fine gravel; little silt; grey; loose; no odor or staining.	0.0
6	8	SS	3-3-2-4	0.0		No recovery.	
8	10	SS	3-2-1-3	1.7	Wet at 9.5	SAND, fine; some silt; trace fine gravel; trace clay; loose; grey-brown; no odor or staining.	0.0
10	12	SS	2-2-2-2	0.8	Wet	SAND, fine; some silt; trace fine gravel; trace clay; loose; grey-brown; no odor or staining.	0.0
12	14	SS	2-2-2-2	0.0		No recovery	
14	16	SS	3-4-4-4	0.3	Wet	SAND, fine; some silt; trace fine gravel; trace clay; loose; grey-brown; no odor or staining.	0.0

PROJECT: Mr. Cleaners	JOB NUMBER: NEW9628.p2
WELL NO.: HRP-MW-2	PAGE 2 OF 2

DEPTH (FEET)		SAMPLE TYPE	BLOW COUNT	REC. (FEET)	MOISTURE	DESCRIPTION	PID READING (PPM)
FROM	TO						
16	18	SS	6-4-4-10	1.0	Wet	SAND, fine; some silt; trace fine gravel; trace clay; loose; grey-brown; no odor or staining.	0.0
18	20	SS	6-3-3-6	1.2	Wet Moist	18 to 19.5: SAND, fine; some silt; trace fine gravel; trace clay; loose; grey; no odor or staining. 19.5 to 20: Organic peat material; no odor no staining.	0.0 0.0
20	22	SS	4-2-2-4	1.4	Moist	Organic peat material; no odor no staining.	0.0
22	24	SS	5-5-6-5	1.6	Moist	22 to 23: Organic peat material; no odor no staining. 23 to 24: Organic SILT	0.0 0.0
24	26	SS	2-1-2-1	0.9	Moist	SILT; trace clay; trace organics; grey; loose; no odor or staining.	0.0
26	28	SS	2-7-4-5	1.0	Moist	SILT; trace clay; trace organics; grey; loose; no odor or staining.	0.0
28	30	SS	9-6-4-6	1.0	Moist	SILT and CLAY; trace organics; no odor or staining.	0.0
30	32	SS	6-5-4-9	0.4	Wet	Coarse to fine SAND and GRAVEL; some silt; loose; brown; no odor or staining.	0.0
32	34	SS	10-5-22-9	0.4	Wet	Coarse to fine SAND and GRAVEL; some silt; loose; brown; no odor or staining.	0.0
34	36	SS	12-7-5-6	0.6	Wet	SAND, coarse to fine; some gravel; trace silt; brown; loose; no odor or staining.	0.0
36	38	SS	5-3-4-4	0.6	Wet	SAND, coarse to fine; some gravel; trace silt; brown; loose; no odor or staining.	0.0
38	40	SS	12-11-6-8	0.7	Wet	SAND, coarse to fine; some gravel; trace silt; brown; loose; no odor or staining.	0.0
40	42	SS	5-16-12-11	0.8	Wet	SAND, coarse to fine; little gravel; trace silt; brown; compact; no odor or staining.	0.0
42	44	SS	21-9-9-12	1.3	Wet	SAND, coarse to fine; little gravel; trace silt; brown; compact; no odor or staining.	0.0
	44					Auger refusal, end of boring.	

HRP Engineering, P.C.
Monitoring Well Installation Log

WELL NO: HRP-MW-3

PAGE 1 **OF** **PAGES**

PROJECT: Mr. Cleaners	**SCREEN SIZE & TYPE:** Continuous wrap PVC 2 inch
JOB NUMBER: NEW9628.p2	**SLOT NO.:** 10 **SETTING:** 22 to 52 ftbg
DATE COMPLETED: 4/3/12	**SAND PACK SIZE & TYPE:** 00
DRILLING COMPANY: Geologic	**SETTING:** 20 to 52 ftbg
RIG TYPE: Hollow Stem Auger	**CASING SIZE & TYPE:** 2 inch schedule 40 PVC
DRILLING METHOD: Mud Rotary	**SETTING:** 0.5 to 22 ftbg
HAMMER WEIGHT/DROP: N/A	**SEAL TYPE:** Bentonite pellets
SAMPLING METHOD: Split Spoon	**SETTING:** 20 to 14 ftbg
OBSERVER: James Charter	**BACKFILL TYPE:** Portland cement
REFERENCE POINT (RP): Grade	**STATIC WATER LEVEL:** 10 ftbg
STICK-UP: None	**GPS COORDINATES: N:**
SURFACE COMPLETION: Flush-mounted curb-box	**W:**

REMARKS: Asphalt 0.5' thick

ABBREVIATIONS: SS = split spoon W = wash C = cuttings G = grab ST = shelby tube REC = recovery PPM = parts per million

DEPTH (FEET) FROM	DEPTH (FEET) TO	SAMPLE TYPE	BLOW COUNT	REC. (FEET)	MOISTURE	DESCRIPTION	PID READING (PPM)
0.5	2	SS	16-12-7	1.0	Moist	SAND, coarse to fine; some silt; little gravel; gray; loose; no odor or staining.	0.0
2	4	SS	4-4-4-4	1.0	Moist	SAND, coarse to fine; some silt; little gravel; gray; loose; no odor or staining.	0.0
4	6	SS	2-2-2-2	1.1	Moist	SAND, coarse to fine; some silt; little gravel; gray; loose; no odor or staining.	0.0
6	8	SS	2-2-3-3	1.0	Moist	SAND, coarse to fine; some silt; little gravel; gray; loose; no odor or staining.	0.0
8	10	SS	2-1-3-4	0.7	Moist	SAND, coarse to fine; some silt; little gravel; trace clay; gray; loose; no odor or staining.	0.0
10	12	SS	1-50/0.5	0.2	Moist	SAND, coarse to fine; some silt; little gravel; trace clay; gray; loose; no odor or staining.	0.0
12	14	SS	7-5-6-9	1.5	Moist	SAND, coarse to fine, some silt; trace fine gravel; gray; loose; no odor or staining.	0.0

PROJECT: Mr. Cleaners	JOB NUMBER: NEW9628.p2

WELL NO.: HRP-MW-3 **PAGE 2 OF**

DEPTH (FEET)		SAMPLE TYPE	BLOW COUNT	REC. (FEET)	MOISTURE	DESCRIPTION	PID READING (PPM)
FROM	TO						
14	16	SS	6-10-5-13	1.5	Wet	SAND, coarse to fine, some silt; trace fine gravel; trace wood; gray; loose; no odor or staining.	0.0
16	18	SS	8-5-9-17	1.5	Wet Moist	16 to 17.5: SAND, coarse to fine, some silt; trace fine gravel; trace wood; gray; loose; no odor or staining. 17.5 to 18: Organic peat material; no odor no staining.	0.0 0.0
18	20	SS	6-3-33-46	0.3	Moist	Organic peat material; no odor no staining.	0.0
20	22	SS	8-8-8-9	0.3	Wet	SAND, coarse to fine; little gravel; little organic peat; dark brown; loose; no odor or staining.	0.0
22	24	SS	18-20-26-26	1.2	Wet	SAND, coarse to fine; little gravel; little organic peat; dark brown; loose; no odor or staining.	0.0
24	26	SS	24-17-21-33	1.0	Wet	Fine SAND and SILT; little gravel; trace medium to coarse sand; medium compact; brown; no odor or staining.	0.0
26	28	SS	36-30-24-35	1.6	Wet	Fine SAND and SILT; little gravel; trace medium to coarse sand; medium compact; brown; no odor or staining.	0.0
28	30	SS	28-29-42-37	0.8	Wet	SAND; coarse to fine; some gravel; little silt; brown; compact; no odor or staining.	0.0
30	32	SS	18-22-32-44	1.0	Wet	SAND; coarse to fine; some gravel; little silt; brown; compact; no odor or staining.	0.0
32	34	SS	38-56-39-68	0.7	Wet	SAND; coarse to fine; some gravel; little silt; brown; compact; no odor or staining.	0.0
34	36	SS	50/0.25	0.0		No Recovery	
36	38	SS	21-30-22-50/0.2	0.3	Wet	SAND; medium to coarse; some large weathered gravel; compact; brown; no odor or staining.	0.0
38	40	SS	75/0.15	0.0		No Recovery	
40	42	SS	29-24-50/0.4	0.6	Wet	SAND, fine; some gravel; brown; compact; no odor or staining.	0.0
42	44	SS	54-23-24-50	0.6	Wet	SAND, fine; some gravel; brown; compact; no odor or staining.	0.0
44	46	SS	53-49-47-66	1.1	Wet	SAND, fine; some silt; little gravel brown; compact; no odor or staining.	
46	48	SS	55-75/0.35	0.6	Wet	SAND, fine and SILT; little fine gravel; compact; brown; no odor; no staining.	0.0
48	50	SS	50/0	0.0		No Recovery, mud rotary to 51’ where softer material is encountered	
51	53	SS	90/0.5	0.2	Moist	SILT; some gravel; very compact; green/grey; no odor or staining.	0.0
52	54	SS	50/0	0.0		No Recovery	
	55					End of boring.	

HRP Engineering, P.C.
Monitoring Well Installation Log

WELL NO: HRP-MW-4

PAGE 1 **OF** 2 **PAGES**

PROJECT: Mr. Cleaners	**SCREEN SIZE & TYPE:** Continuous wrap PVC 2 inch
JOB NUMBER: NEW9628.p2	**SLOT NO.:** 10 **SETTING:** 13 to 28 ftbg
DATE COMPLETED: 4/4/12	**SAND PACK SIZE & TYPE:** 00
DRILLING COMPANY: Geologic	**SETTING:** 11 to 28 ftbg
RIG TYPE: Hollow Stem Auger	**CASING SIZE & TYPE:** 2 inch schedule 40 PVC
DRILLING METHOD: Hollow Stem Auger	**SETTING:** 0.5 to 13 ftbg
HAMMER WEIGHT/DROP: 140	**SEAL TYPE:** Bentonite pellets
SAMPLING METHOD: Split Spoon	**SETTING:** 11 to 8 ftbg
OBSERVER: Mark Wright	**BACKFILL TYPE:** Portland cement
REFERENCE POINT (RP): Grade	**STATIC WATER LEVEL:** 10 ftbg
STICK-UP: None	**GPS COORDINATES: N:**
SURFACE COMPLETION: Flush-mounted curb-box	**W:**

REMARKS: Asphalt 0.5' thick

ABBREVIATIONS: SS = split spoon W = wash C = cuttings G = grab ST = shelby tube REC = recovery PPM = parts per million

DEPTH (FEET) FROM	DEPTH (FEET) TO	SAMPLE TYPE	BLOW COUNT	REC. (FEET)	MOISTURE	DESCRIPTION	PID READING (PPM)
0.5	2	SS	6-12-8	1.0	Dry	SAND, medium; little gravel; grey-brown; loose; no odor or staining. Paper and wire observed in cuttings.	0.0
2	4	SS	6-4-4-9	0.2	Dry	SAND, medium; little gravel; grey-brown; loose; no odor or staining. Wood in tip of spoon.	0.0
4	6	SS	29-7-2-5	0.8	Moist	SAND, medium; little gravel; grey-brown; loose; no odor or staining.	0.0
6	8	SS	5-5-4-2	1.2	Moist	SAND, fine; some silt; little gravel; brown-grey; loose; no odor or staining.	0.0
8	10	SS	3-6-14-5	0.9	Moist	SAND, fine; some silt; little gravel; brown-grey; loose; no odor or staining.	1.4
10	12	SS	2-3-2-2	1.2	Moist	SILT and fine SAND; little gravel; wood; roots; brown; loose; no odor or staining.	0.0
12	14	SS	3-3-9-8	1.2	Moist	SAND, medium; some gravel; light brown; loose; no odor or staining.	0.0

PROJECT: Mr. Cleaners	JOB NUMBER: NEW9628.p2
WELL NO.: HRP-MW-4	PAGE 2 OF 2

DEPTH (FEET)		SAMPLE TYPE	BLOW COUNT	REC. (FEET)	MOISTURE	DESCRIPTION	PID READING (PPM)
FROM	TO						
14	16	SS	3-7-8-8	1.3	Moist	Medium to coarse SAND and GRAVEL; grey; loose; no odor or staining.	0.0
16	18	SS	7-9-7-8	1.0	Wet at 17’	Medium to coarse SAND and GRAVEL; brown; loose; no odor or staining.	0.0
18	20	SS	4-5-5-5	1.0	Wet Wet	18 to 18.5: Medium to coarse SAND and GRAVEL; brown; loose; no odor or staining. 18.5 to 20: SAND. Fine; brown; loose; no odor or staining.	0.0 0.0
20	22	SS	6-14-16-11	1.2	Wet	SAND, fine; some silt; brown; loose; no odor or staining.	0.0
22	24	SS	6-3-3-2	1.4	Wet	SAND, coarse; some gravel; little silt; light brow; loose; no odor or staining.	0.0
24	26	SS	6-7-14-17	1.3	Wet	SAND, coarse; some gravel; little silt; light brow; loose; no odor or staining.	0.0
26	28	SS	18-14-15-24	2.0	Wet Wet	26-27.5: SAND, coarse; some gravel; little silt; light brow; loose; no odor or staining. 27.5-28: SAND, medium to fine; some gravel; tan; loose; no odor or staining.	0.0 0.0
28	30	SS	7-23-19-17	1.7	Wet	SAND, medium to fine; some gravel; tan; loose; no odor or staining.	0.0
	30					End of Boring.	

HRP Engineering, P.C.
Monitoring Well Installation Log

WELL NO: HRP-MW-5

PAGE 1 **OF** 2 **PAGES**

PROJECT: Mr. Cleaners	**SCREEN SIZE & TYPE:** Continuous wrap PVC 2 inch
JOB NUMBER: NEW9628.p2	**SLOT NO.:** 10 **SETTING:** 14 to 29 ftbg
DATE COMPLETED: 4/5/12	**SAND PACK SIZE & TYPE:** 00
DRILLING COMPANY: Geologic	**SETTING:** 12 to 29 ftbg
RIG TYPE: Hollow Stem Auger	**CASING SIZE & TYPE:** 2 inch schedule 40 PVC
DRILLING METHOD: Hollow Stem Auger	**SETTING:** 0.5 to 14 ftbg
HAMMER WEIGHT/DROP: 140	**SEAL TYPE:** Bentonite pellets
SAMPLING METHOD: Split Spoon	**SETTING:** 12 to 7 ftbg
OBSERVER: Mark Wright	**BACKFILL TYPE:** Portland cement
REFERENCE POINT (RP): Grade	**STATIC WATER LEVEL:** 18.3 ftbg
STICK-UP: None	**GPS COORDINATES: N:**
SURFACE COMPLETION: Flush-mounted curb-box	**W:**

REMARKS: Asphalt 0.5' thick

ABBREVIATIONS: SS = split spoon W = wash C = cuttings G = grab ST = shelby tube REC = recovery PPM = parts per million

DEPTH (FEET) FROM	DEPTH (FEET) TO	SAMPLE TYPE	BLOW COUNT	REC. (FEET)	MOISTURE	DESCRIPTION	PID READING (PPM)
0.5	2	SS	15-16-16	1.2	Dry	SAND, fine; some silt; little gravel; brown-grey; medium compact; no odor or staining.	0.0
2	4	SS	29-26-21-31	1.9	Dry	SAND, fine; some silt; little gravel; brown-grey; medium compact; no odor or staining.	0.0
4	6	SS	8-11-7-6	1.4	Dry	SAND, fine; some silt; little gravel; brown-grey; medium compact; no odor or staining.	15.8
6	8	SS	7-10-14-13	1.0	Dry	SAND, fine; some silt; little gravel; brown-grey; medium compact; no odor or staining.	5.8
8	10	SS	4-8-9-13	0.7	Dry	SAND, fine; some silt; little gravel; brown-grey; medium compact; no odor or staining.	22.7
10	12	SS	10-8-8-8	0.9	Moist	10 to 10.7: SAND, fine; some silt; little gravel; brown-grey; medium compact; no odor or staining.	0.0
					Moist	10.7 to 12: SAND, medium; little fine gravel; brown; loose; no odor or staining	0.0

PROJECT: Mr. Cleaners	JOB NUMBER: NEW9628.p2
WELL NO.: HRP-MW-5	PAGE 2 OF 2

DEPTH (FEET)		SAMPLE TYPE	BLOW COUNT	REC. (FEET)	MOISTURE	DESCRIPTION	PID READING (PPM)
FROM	TO						
12	14	SS	15-41-50/0.2	0.0		No Recovery	
14	16	SS	20-12-12-9	0.9	Dry	SAND, medium; some gravel; brown; loose; no odor or staining.	2.2
16	18	SS	9-8-9-9	1.8	Moist	SAND, medium; some gravel; brown; loose; no odor or staining.	17.0
18	20	SS	4-6-5-7	1.4	Wet	SAND, fine to coarse; brown; loose; no odor or staining.	0.4
20	22	SS	3-3-3-5	1.4	Wet	SAND, fine to coarse; brown; loose; no odor or staining.	0.2
22	24	SS	9-12-3-3	1.7	Wet Wet	22 to 23.5: SAND, fine to coarse; brown; loose; no odor or staining. 23.5 to 24: Coarse SAND and GRAVEL; brown; loose; no odor or staining.	0.0 0.0
24	26	SS	11-17-16-20	2.0	Wet	Coarse SAND and GRAVEL; little silt; compact; dark brown; no odor or staining.	0.0
26	28	SS	50/0.2	0.0		No recovery	
28	30	SS	14-17-19-19	2.0	Wet	SAND, medium; some fine gravel; compact; brown; no odor or staining.	0.0
30	32	SS	7-8-8-13	1.3	Wet	SAND, fine; little silt; little gravel; compact; brown; no odor or staining.	0.0
32	34	SS	8-22-16-39	1.8	Wet	SAND, fine; some silt; little gravel; compact; brown; no odor or staining.	0.0
34	36	SS	49-56-49-87	0.6	Moist	SILT and fine SAND and fine GRAVEL; trace clay; very compact; tan; no odor or staining; till.	0.0
	36					End of Boring	

HRP Engineering, P.C.
Monitoring Well Installation Log

WELL NO: HRP-MW-6

PROJECT: Mr. Cleaners	**SCREEN SIZE & TYPE:** Continuous wrap PVC 2 inch
JOB NUMBER: NEW9628.p2	**SLOT NO.:** 10 **SETTING:** 15 to 25 ftbg
DATE COMPLETED: 4/9/12	**SAND PACK SIZE & TYPE:** 00
DRILLING COMPANY: Geologic	**SETTING:** 13 to 25 ftbg
RIG TYPE: Hollow Stem Auger	**CASING SIZE & TYPE:** 2 inch schedule 40 PVC
DRILLING METHOD: Hollow Stem Auger	**SETTING:** 0.5 to 15 ftbg
HAMMER WEIGHT/DROP: 140	**SEAL TYPE:** Bentonite pellets
SAMPLING METHOD: Split Spoon	**SETTING:** 13 to 8 ftbg
OBSERVER: Mark Wright	**BACKFILL TYPE:** Portland cement
REFERENCE POINT (RP): Grade	**STATIC WATER LEVEL:** 19.3 ftbg
STICK-UP: None	**GPS COORDINATES: N:**
SURFACE COMPLETION: Flush-mounted curb-box	**W:**

REMARKS: Asphalt 0.5’ thick

ABBREVIATIONS: SS = split spoon W = wash C = cuttings G = grab ST = shelby tube REC = recovery PPM = parts per million

DEPTH (FEET) FROM	DEPTH (FEET) TO	SAMPLE TYPE	BLOW COUNT	REC. (FEET)	MOISTURE	DESCRIPTION	PID READING (PPM)
0.5	2	SS	7-14-25	1.1	Dry	SAND, medium; little fine gravel; trace coarse gravel; grey-brown; medium compact; no odor or staining	0.0
2	4	SS	50/0.3	0.4	Dry	SAND, medium; little fine gravel; trace coarse gravel; grey-brown; medium compact; no odor or staining	0.0
4	6	SS	18-12-12-18	1.0	Dry	SAND, medium; some fine gravel; trace silt; brown; loose; no odor or staining.	0.0
6	8	SS	12-9-8-13	1.4	Dry	SAND, medium; little gravel; little silt; brown; loose; no odor or staining.	0.0
8	10	SS	9-16-16-17	0.2	Dry	SAND, medium; little gravel; little silt; brown; loose; no odor or staining.	0.0
10	12	SS	18-13-16-15	1.9	Moist Moist	10-11: SAND, medium; little gravel; little silt; brown; loose; no odor or staining. 11-12: SAND, medium to coarse; some gravel; brown; loose; no odor or staining	0.0 128.6

PROJECT: Mr. Cleaners	JOB NUMBER: NEW9628.p2
WELL NO.: HRP-MW-6	PAGE 2 OF 2


DEPTH (FEET)		SAMPLE TYPE	BLOW COUNT	REC. (FEET)	MOISTURE	DESCRIPTION	PID READING (PPM)
FROM	TO						
12	14	SS	12-15-10-10	0		No recovery	
14	16	SS	8-9-16-12	1.2	Moist	SAND, medium to coarse; some gravel; brown; loose; no odor or staining	29.0
16	18	SS	12-11-10-11	1.5	Moist	SAND, medium to coarse; some gravel; brown; loose; no odor or staining	14.2
18	20	SS	8-9-11-6	1.1	Wet at 19’	SAND, medium to coarse; little fine grave; brown; loose; no odor or staining.	28.0
20	22	SS	2-5-5-5	0.7	Wet	SAND, medium to coarse; little fine grave; brown; loose; no odor or staining.	11.7
22	24	SS	5-5-5-5	0.3	Wet	SAND, medium to coarse; little fine grave; brown; loose; no odor or staining.	5.1
24	26	SS	12-18-16-12	1.8	Wet	Coarse SAND and fine GRAVEL; loose; brown; no odor or staining.	0.5
26	28	SS	9-16-28-21	1.3	Wet	Coarse SAND and fine GRAVEL; loose; brown; no odor or staining.	0.0
	28					End of boring	

EXCEL Environmental Resources, Inc.

MONITORING WELL LOG
MW-7

PROJECT INFORMATION		DRILLING INFORMATION	
PROJECT:	**Mr Cleaners - Shrub Oak**	DRILLING CO.:	**AmeriDrill, Inc**
SITE LOCATION:	**1360 East Main Street Shrub Oak, NY**	DRILLER:	**Tom Brown**
		RIG TYPE:	**HS Auger**
JOB NO.:	**12229**	DRILLING METHOD:	**4" Hollow-Stem Auger**
LOGGED BY:	**Michael Bonafede**	SAMPLING METHOD:	**2' split-spoons**
DATE STARTED:	**12/8/2015**	HAMMER WT./DROP:	**N/A**
DATE FINISHED:	**12/8/2015**	COMPLETION DEPTH:	**36.5**
		GROUNDWATER DEPTH:	**24'**

DEPTH (feet)	SOIL LITH	PID (ppm)	SOIL DESCRIPTION
0			
		0.0	0.0 - 0.5' Asphalt
		7.9	0.5 - 2.0' Brown medium to fine SAND, some Silt
		6.9	2.0 - 3.0' Brown medium to fine SAND, some Silt and Gravel
		21.6	
5		61.9	3.0 - 5.0' Brown medium to fine SAND and SILT
		9,000	
		0.0	5.0 - 8.0' Brown coarse to medium SAND, some Gravel
			8.0 - 10.0' Brown coarse to medium SAND and SILT, some Gravel
10		76.3	
		396	10.0 - 13.0' Brown medium to fine SAND, some cobbles
		1,551	
		67.1	13.0 - 14.0' Brown coarse SAND, some Gravel
		23.7	
15		290	14.0 - 15.0' Grey coarse to medium SAND, some Gravel
		425	15.0 - 17.0' Grey fine SAND and SILT, some Gravel
		49.4	
		16.0	17.0 - 18.0' Brown coarse to medium SAND
		0.0	18.0 - 19.0' Brown coarse to medium SAND, some Gravel
20			
		2.7	19.0 - 24.0' Brown coarse to medium SAND
▼			24.0 - 25.0' Medium to Coarse Brown SAND, some Gravel, some Cobbles
25		1.0	25.0 - 28.0' Fine Brown SAND, some pebbles
		0.8	28.0 - 29.0' Medium to Coarse Brown SAND, some gravel, some cobbles
			29.0 - 34' Gravel and Cobbles, some Fine to Medium Sand
30		0	
			34.0 - 36.5' Gravel, some Cobbles
35			36.5' Refusal

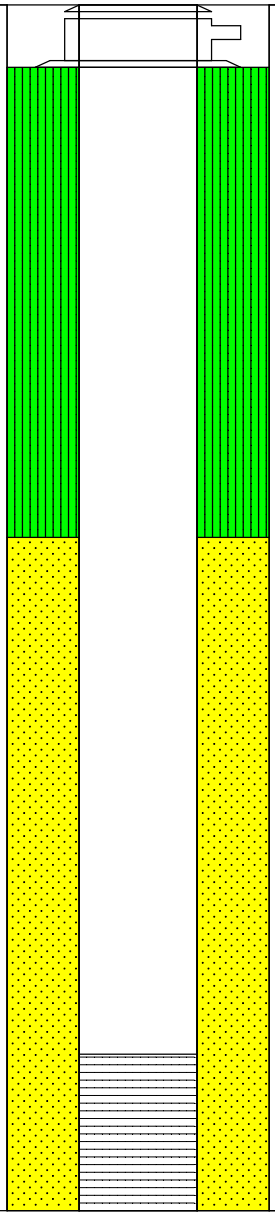


MONITORING WELL LOG	WELL CONSTRUCTION
	Stickup Casing
	0.0 - 15.0' Cement/Bentonite
	0.0 - 31.5' 2" PVC Sch 40
	Sand Pack: 15.0 - 36.5' #00 WG Sand
	Screen: 31.5 - 36.5' 2" PVC Sch 40 (0.010 slot)

NOTES: 40 degrees fahrenheit, partly cloudy, Sunny

EXCEL Environmental Resources, Inc.

MONITORING WELL LOG
MW-8

PROJECT INFORMATION		DRILLING INFORMATION	
PROJECT:	**Mr Cleaners - Shrub Oak**	DRILLING CO.:	**AmeriDrill, Inc**
SITE LOCATION:	**1360 East Main Street Shrub Oak, NY**	DRILLER:	**Tom Brown**
		RIG TYPE:	**HS Auger**
JOB NO.:	**12229**	DRILLING METHOD:	**4'' Hollow-Stem Auger**
LOGGED BY:	**Michael Bonafede**	SAMPLING METHOD:	**2' split-spoons**
DATE STARTED:	**12/9/2015**	HAMMER WT./DROP:	**N/A**
DATE FINISHED:	**12/9/2015**	COMPLETION DEPTH:	**40.0'**
		GROUNDWATER DEPTH:	**18.0'**

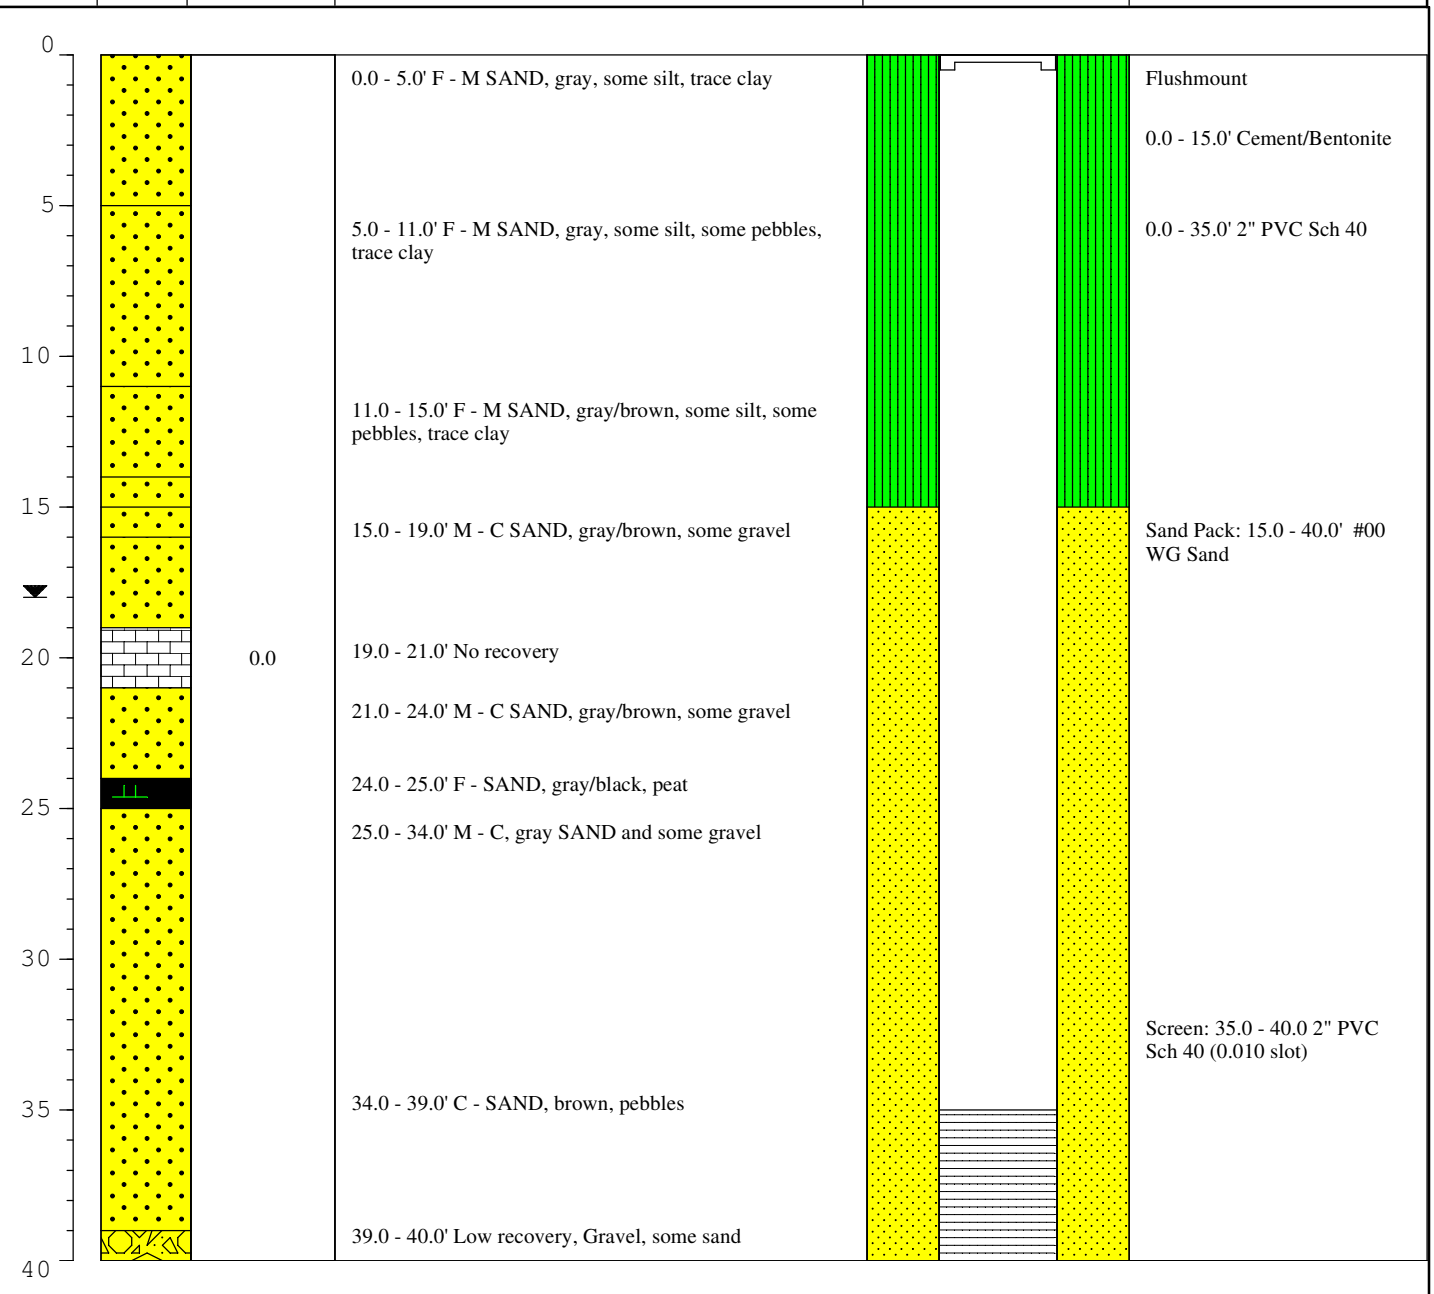


NOTES: 40 degrees fahrenheit, partly cloudy, Sunny

EXCEL Environmental Resources, Inc.

MONITORING WELL LOG
MW-9

PROJECT INFORMATION		DRILLING INFORMATION	
PROJECT:	**Mr Cleaners - Shrub Oak**	DRILLING CO.:	**AmeriDrill, Inc**
SITE LOCATION:	**1360 East Main Street Shrub Oak, NY**	DRILLER:	**Tom Brown**
		RIG TYPE:	**HS Auger**
JOB NO.:	**12229**	DRILLING METHOD:	**4'' Hollow-Stem Auger**
LOGGED BY:	**Michael Bonafede**	SAMPLING METHOD:	**2' split-spoons**
DATE STARTED:	**12/8/2015**	HAMMER WT./DROP:	**N/A**
DATE FINISHED:	**12/8/2015**	COMPLETION DEPTH:	**40.0**
		GROUNDWATER DEPTH:	**20.0**

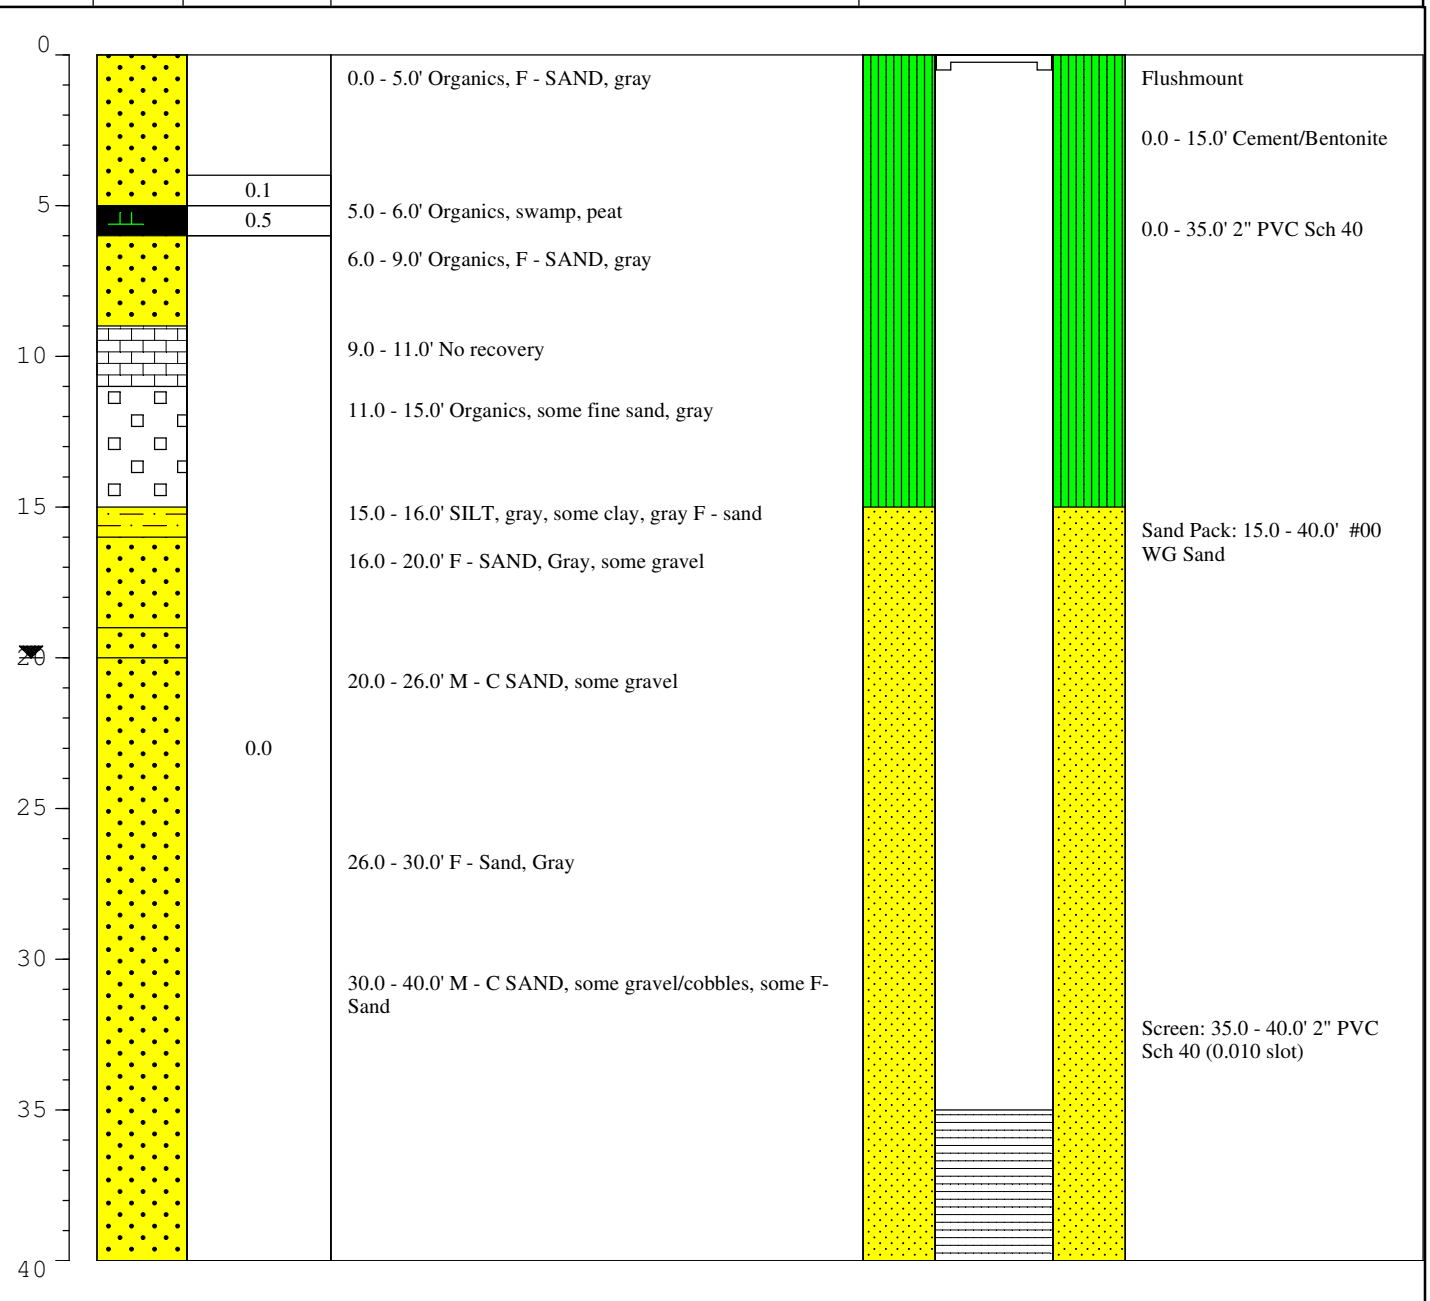


NOTES: 40 degrees fahrenheit, partly cloudy, Sunny

EXCEL Environmental Resources, Inc.

MONITORING WELL LOG
MW-10

PROJECT INFORMATION		DRILLING INFORMATION	
PROJECT:	**Mr Cleaners - Shrub Oak**	DRILLING CO.:	**AmeriDrill, Inc**
SITE LOCATION:	**1360 East Main Street Shrub Oak, NY**	DRILLER:	**Tom Brown**
		RIG TYPE:	**HS Auger**
JOB NO.:	**12229**	DRILLING METHOD:	**4" Hollow-Stem Auger**
LOGGED BY:	**Michael Bonafede**	SAMPLING METHOD:	**2' split-spoons**
DATE STARTED:	**12/8/2015**	HAMMER WT./DROP:	**N/A**
DATE FINISHED:	**12/8/2015**	COMPLETION DEPTH:	**40.0**
		GROUNDWATER DEPTH:	**21.0**

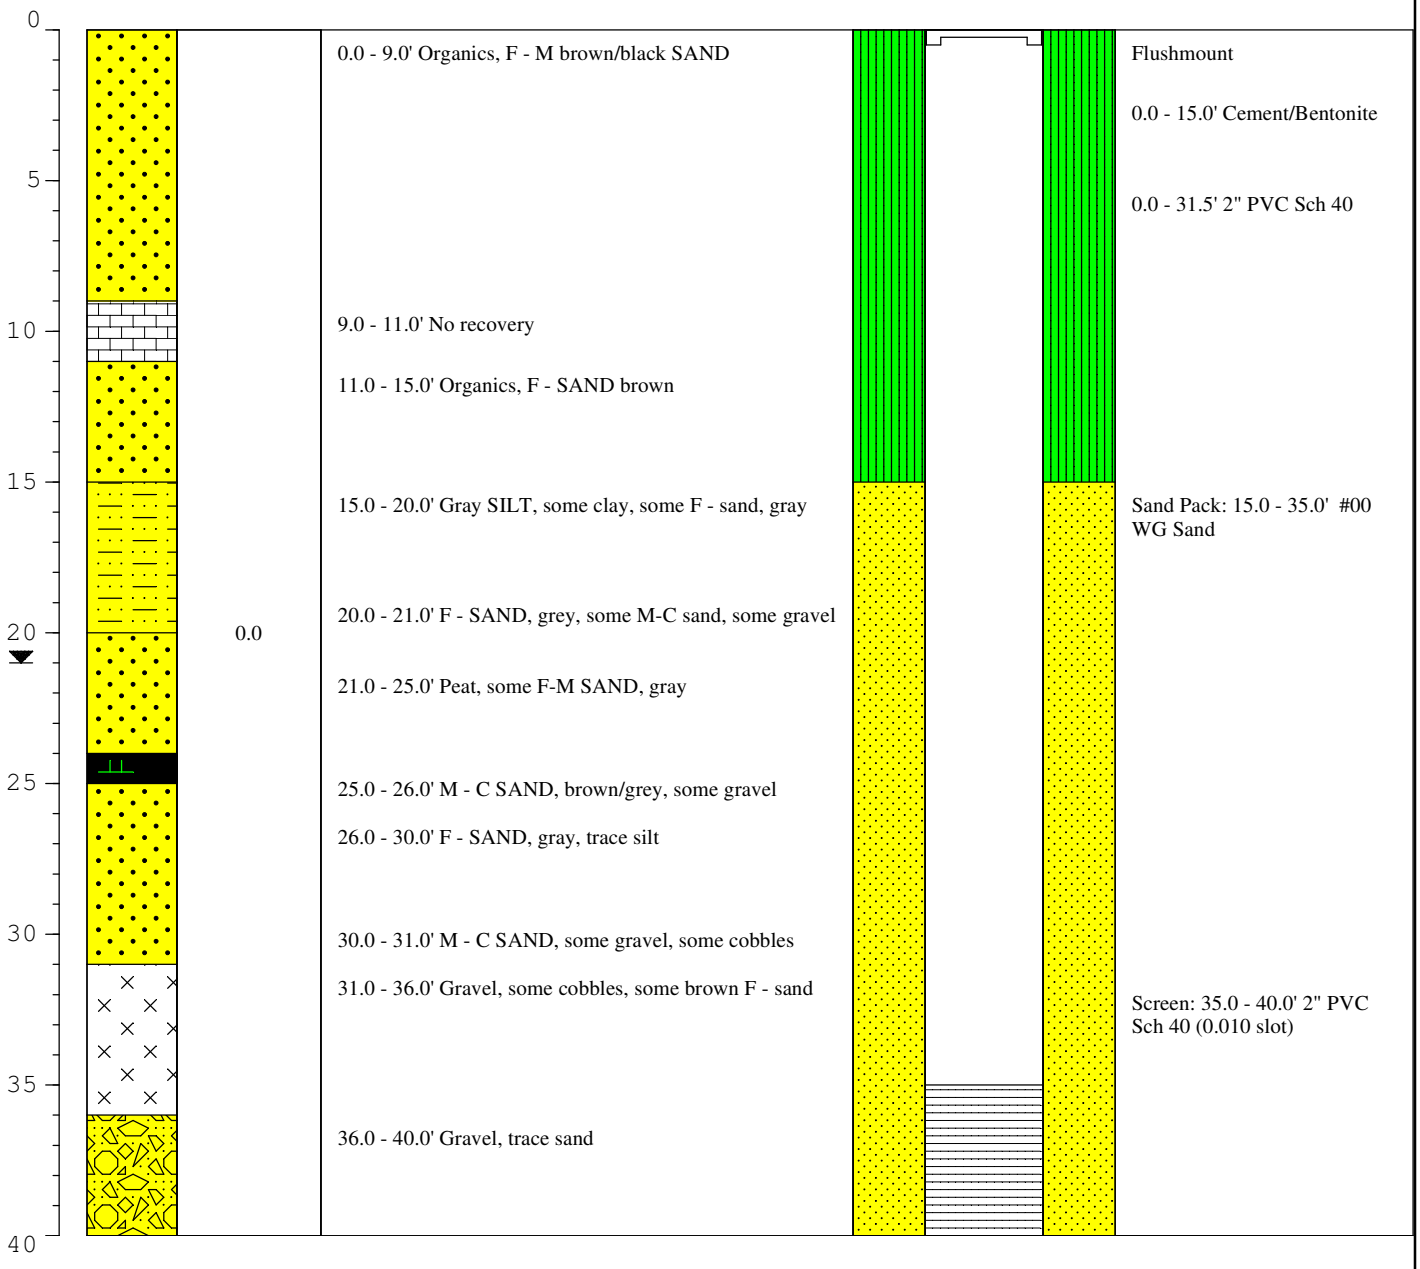

NOTES: 40 degrees fahrenheit, partly cloudy, Sunny

EXCEL Environmental Resources, Inc.

MONITORING WELL LOG
MW-11

PROJECT INFORMATION		DRILLING INFORMATION	
PROJECT:	**Mr Cleaners - Shrub Oak**	DRILLING CO.:	**AmeriDrill, Inc**
SITE LOCATION:	**1360 East Main Street Shrub Oak, NY**	DRILLER:	**Tom Brown**
		RIG TYPE:	**HS Auger**
JOB NO.:	**12229**	DRILLING METHOD:	**4'' Hollow-Stem Auger**
LOGGED BY:	**Michael Bonafede**	SAMPLING METHOD:	**2' split-spoons**
DATE STARTED:	**12/9/2015**	HAMMER WT./DROP:	**N/A**
DATE FINISHED:	**12/9/2015**	COMPLETION DEPTH:	**27.50'**
		GROUNDWATER DEPTH:	**25.50'**

DEPTH (feet)	SOIL LITH	PID (ppm)	SOIL DESCRIPTION	MONITORING WELL LOG	WELL CONSTRUCTION
0			0.0 - 5.0' Organics, F - M brown SAND, some gravel		Flushmount
					0.0 - 15.0' Cement/Bentonite
5			5.0 - 6.0' M - C SAND, brown, trace silt		0.0 - 31.5' 2" PVC Sch 40
			6.0 - 10.0' Organics, F - M brown SAND, some pebbles		
10			10.0 - 11.0' F - SAND, brown		
			11.0 - 15.0' F - M SAND, brown, some pebbles		
		0.0			
15			15.0 - 20.0' F - M SAND, brown, some gravel		Sand Pack: 15.0 - 27.5' #00 WG Sand
20			20.0 - 21.0' F - SAND, brown, some pebbles		
			21.0 - 25.0' F - M SAND, brown, some gravel		Screen: 22.5 - 27.5' 2" PVC Sch 40 (0.010 slot)
25			25.0 - 27.5' F - M SAND, brown, some gravel, some cobbles		

NOTES: 40 degrees fahrenheit, partly cloudy, Sunny

APPENDIX C

Groundwater Sampling Logs

Well Sampling Data Form

Client: _____ **Project Number:** _____

Site Location: _____

Well No: _____ Weather: _____

Date: _____ Purge Water Disposal: _____

Sampled By: _____ Well Diameter / Type: _____

Depth of Well (ft): _____ Water Column (ft): _____

Depth to Water(ft): _____ Volume of Water in Well (gal) _____

Depth to Product (ft): _____ Volume of Water to Remove (gal): _____

well diameter:	1 in	2 in	4 in	6 in	8 in
gallons per foot:	0.041	0.163	0.653	1.469	2.611

Start Purging: _____ Purge Rate: _____

End Purging: _____ Volume of Water Removed (gal): _____

Method of Purge: _____ Method of Sampling: low-flow

Physical Appearance/
Comments: _____

Samples Collected:
(analyses / no. bottles) _____

Time: _____ Laboratory : _____

Field Measurements:

Time	**DTW** ft	**Flow Rate** ml/min	**ORP** mV (+/- 10 mV)	**Conductivity** **mS/m** - S/m **(w/in 3%)**	**Turbidity** NTU (w/in %10)	**pH** SU (+/- 0.1)	**Temperature** **C°** - *F°* **(w/in 3%)**	**Dissolved O_2** mg/L (w/in 10%)

APPENDIX D

Site-Specific Health and Safety Plan

Site-Specific Health and Safety Plan

1360 East Main Street
Shrub Oak, New York

July 15, 2026

Prepared for:

Shrub Oak Partners, LLC

Prepared by:

Roux Environmental Engineering and Geology, D.P.C.
209 Shafter Street
Islandia, New York 11749

3950.0001Y133/cv

Environmental Consulting
& Management
+1.800.322.ROUX
rouxinc.com

Table of Contents

Site-Specific Emergency Information iv
Emergency Phone Numbers iv

1. Introduction 1
1.1 Roles and Responsibilities 1

2. Background 4
2.1 Site Description 4

3. Scope of Work 5

4. Site Control 6
4.1 Site Map 6
4.2 Site Access 6
4.3 Buddy System 6
4.4 Site Communications 6
4.5 Site Work Zones 7

5. Job Hazard Evaluation 9
5.1 Hazard Communication and Overall Site Information Program 10
5.2 Noise 10
5.3 Slip, Trip, and Fall Hazards 10
5.4 Biological Hazards 10

6. Emergency Response Plan 11
6.1 Emergency Response 11
6.2 Emergency Alerting and Evacuation 11
6.3 Emergency Medical Treatment and First Aid 11

7. Environmental Conditions and Response 13
7.1 Adverse Weather Conditions 13
7.2 Electrical Storm Guidelines 13
7.3 Environmental Stressors, Heat Stress, Heat Exhaustion, and Heat Stroke 13
7.3.1 Heat Stress 14
7.3.2 Heat Cramps 14
7.3.3 Heat Exhaustion 15
7.3.4 Heat Stroke 15
7.4 Cold Stress 15

8. Safety Procedures 17
8.1 Training 17
8.2 Site-Specific Safety Briefings for Visitors 17
8.3 HASP Information and Site-Specific Briefings for Workers 17
8.4 Medical Surveillance 18
8.4.1 Site Medical Surveillance Program 18
8.4.2 Medical Recordkeeping Procedures 18
8.4.3 Program Review 19

8.5 Personnel Protection 19
8.5.2 Hearing Conservation 20
8.6 Monitoring 20
8.6.1 Action Levels for Air Monitoring 20
8.6.2 Explosive Hazard 22
8.6.3 Air Monitoring Equipment and Calibration 22
8.7 Tailgate Safety Meetings 23
8.8 Spill Containment 23
8.8.1 Initial Spill Notification and Response 23
8.8.2 Spill Evaluation and Response 23
8.9 Decontamination 23
8.9.1 Decontamination Procedures for Personnel and PPE 24
8.9.2 Decontamination Procedures for Equipment 24
8.9.3 Monitoring the Effectiveness of Decontamination Procedures 25
8.10 Confined Space Entry 25
8.11 Client and Site-Specific 26
8.12 Unusual or Significant Risks 26
8.13 Activity-Specific Hazards 26
8.13.1 Electrical and Other Utility Assessment and Accommodations 26
8.13.2 Subsurface Work 26
8.13.2.1 Excavations and Trenching 26
8.13.3 Heavy Equipment 28
8.14 Traffic Control 28
8.15 Sanitation 28
9. Field Team Review 29
10. Approvals 30

Tables

1. Toxicological Properties of Hazardous Substances Present at 1360 E Main Street, Shrub Oak, New York

Figures

1. Site Location Map
2. Site Plan with Emergency Muster Area
3. Routes to Urgent Care and Hospital

Appendices

A. Job Safety Analysis (JSA) Forms
B. SDSs for Chemicals Used
C. Heat Illness Prevention Program
D. Personal Protective Equipment (PPE) Management Program
E. Subsurface Utility Clearance Management Program
F. Heavy Equipment Exclusion Zone Management Program

Site-Specific Emergency Information

Emergency Phone Numbers

Most emergency services can be obtained by calling 911. Where 911 service is not available, use the telephone numbers provided in the below table. The following is a master emergency phone list for use by the project management personnel. A more condensed version of the emergency numbers listed below will be posted throughout project work areas. Emergencies encountered on the site will be responded to by a combination of off-site emergency services and on-site personnel.

Emergency Contact Information			
Site Personnel			
Title	**Contact**		**Telephone**
Operations Manager (OM)	Jeffrey Willis		516-637-0213
Project Principal (PP)	Frank Cherena		631-445-0357
Project Manager (PM)	Camila Israel		917-399-5314
Site Supervisor (SS)	Michelle Okvist		631-617-2456
Site Health and Site Safety Officer (SHSO)	Michelle Okvist		631-617-2456
Office Health and Safety Manager (OHSM)	Nevin Pahlad		347-885-6930
Corporate Health and Safety Director (CHSD)	Brian Hobbs, CIH, CSP		631-807-0193
WorkCare, Inc.	Occupational Health Care Management Provider		888-449-7787
Client Emergency Contact			
Outside Assistance			
Agency	**Contact**	**Telephone**	**Address/Location**
Ambulance/emergency medical services (EMS)	Mohegan EMS	914-526-1005	1975 E Main St, Mohegan Lake, NY 10547
Police	Yorktown Police Department	914-962-4141	2281 Crompond Rd, Yorktown Heights, NY 10598
Fire	Mohegan Fire Department	914-528-2116	1975 E Main St, Mohegan Lake, NY 10547
Site Address	1360 E Main Street, Shrub Oak, New York		

Route to Hospital – 1980 Crompond Road, Cortlandt Manor, New York (New York-Presbyterian Hudson Valley Hospital)

See **Figure 3**.

Route to Urgent Care – 3144 E Main Street, Suite 200C, Mohegan Lake, New York (Pulse MD)

See **Figure 3.**

1. Introduction

This Site-specific Health and Safety Plan (HASP) has been prepared by Roux Environmental Engineering and Geology, D.P.C. (Roux)] for use during the site investigation and remediations activities being performed at the Mr. Cleaners – Shrub Oak Shopping Center (Shrub Oak) facility located at 1360 E Main Street, Shrub Oak, New York (Site; **Figure 1**). This HASP was prepared in general accordance with the requirements of the Occupational Safety and Health Administration (OSHA) standards promulgated at 29 CFR 1910.120 and 29 CFR 1926.65, both commonly referred to as the Hazardous Waste Operations and Emergency Response (HAZWOPER) Standard. In accordance with the HAZWOPER Standard, this Site-specific HASP was prepared to address the safety and health hazards associated with the remedial work and to provide requirements and procedures for the protection of Roux employees, subcontractor personnel, government oversight personnel, Site personnel, and the general public activities being performed at the Site by Roux and to provide requirements and procedures for the protection of Roux employees, subcontractor personnel, government oversight personnel, Site personnel, and the general public. It also addresses client- and Site-specific requirements for health and safety. Additionally, subcontractors may be required to submit their own HASP as it relates to their specific work activities and will be kept onsite during such work.

Implementation of this HASP is the joint responsibility of the Project Manager (PM), the Site Health and Safety Officer (SHSO), and all field staff, with assistance from the Project Principal (PP), Office Health and Safety Manager (OHSM), and Corporate Health and Safety Director (CHSD). The PM for this project is Camila Israel. The Site Supervisor (SS) is and Site Health and Safety Officer (SHSO) is Michelle Okvist.

This HASP will be introduced to, reviewed, and signed off on by all Roux personnel through a formal training session prior to commencing work. A copy of the HASP will be kept at the Site at all times. The Roux SHSO or PM will be responsible for posting any changes, amendments, memos, etc. to the HASP. Any revisions to this HASP will be signed by appropriate personnel, which can include Roux's PP, CHSD, and SS. Any changes will be announced to all workers at the next safety meeting.

1.1 Roles and Responsibilities

Overall Roles and Responsibilities (R&Rs) of Roux personnel are provided in Roux's Policies and Procedures Manual. Only those R&Rs specific to HASP requirements are listed below.

Project Manager (PM)

The PM has responsibility and authority to direct all work operations. The PM coordinates safety and health functions with the Site Health and Safety Officer (SHSO), has the authority to oversee and monitor the performance of the SHSO, and bears ultimate responsibility for the proper implementation of this HASP. The specific duties of the PM are:

- Preparing and coordinating the Site work plan;
- Providing Site supervisor(s) with work assignments and overseeing their performance; Coordinating safety and health efforts with the SSHO;
- Ensuring effective emergency response through coordination with the Emergency Response Coordinator (ERC); and
- Serving as primary Site liaison with public agencies and officials and Site contractors.

Site Health and Safety Officer (SHSO)

The SHSO has the full responsibility and authority to develop and implement this HASP and to verify compliance. The SHSO reports to the Project Manager. The SHSO is on Site or readily accessible to the Site during all work operations and has the authority to halt Site work if unsafe conditions are detected. The specific responsibilities of the SHSO include:

- Managing the safety and health functions on this Site;
- Serving as the Site's point of contact for safety and health matters;
- Ensuring Site monitoring, worker training, and effective selection and use of PPE;
- Assessing Site conditions for unsafe acts and conditions and providing corrective action;
- Assisting the preparation and review of this HASP;
- Maintaining effective safety and health records as described in this HASP; and
- Coordinating with the SS and others as necessary for safety and health efforts.

Site Supervisor (SS)

The Site Supervisor (SS) is responsible for field operations and reports to the Project Manager (PM). The SS ensures the implementation of the HASP requirements and procedures in the field. The specific responsibilities of the Site Supervisor include:

- Executing the work plan and schedule as detailed by the PM;
- Coordination with the SHSO on safety and health; and
- Ensuring Site work compliance with the requirements of this HASP.

Employees

All Roux employees are responsible for reading and following all provisions of the Corporate Health and Safety Manual, including this HASP. Employees report to the SS at the project Site. Each employee is also responsible for the following:

- Wearing all appropriate PPE as outlined within this HASP;
- Attending all safety meetings;
- Inspecting tools and equipment prior to use, and taking any defective tools or equipment out of service;
- Appropriately documenting field events as they occur within a logbook or equivalent;
- Properly operating machinery and/or equipment only if trained to do so;
- Stopping work operations if unsafe conditions exist;
- Identifying and mitigating hazards when observed;
- Reporting all incidents and near misses to the Roux SHSO and SS immediately; and
- Knowing where emergency equipment is located (e.g., first aid kit, fire extinguisher).

Subcontractors and Visitors

Subcontractors and visitors are responsible for complying with the same health and safety requirements. It is the responsibility of all to make sure subcontractors and visitors comply and uphold the HASP. Subcontractors and visitors have the following additional responsibilities:

- Designating a qualified safety representative for the project that can make the necessary changes in work practices, as necessary;
- Attending all safety meetings while participating in Roux Site work activities;
- Reporting all incidents and near misses to Roux SHSO and SS immediately;
- Conducting initial and periodic equipment inspections in accordance with manufacturer and regulatory guidelines; and
- Providing copies of all Safety Data Sheets (SDS) to Roux SHSO for materials brought to the Site.

2. Background

Relevant background information is provided below, including a general description of the Site; a brief review of the Site's history with respect to hazardous material use, handling, and/or storage; and a review of known and potential releases of hazardous substances at the Site.

2.1 Site Description

The Site is approximately 3.47 acres and comprised of three connected single-story buildings and an asphalt paved parking lot. The footprint of the building is approximately 46,586 square feet and contains eight tenant spaces. The eight tenant spaces are occupied by an ACME Store #2830, drycleaner, pizzeria, United States Postal Service office, Wells Fargo bank, laundromat, nail salon, and a vacant space that was formerly a Chase bank. A figure showing the site location and boundaries of the Site is provided in Figure 1.

3. Scope of Work

The Scope of Work activities will include the environmental support during the Site's remediation. Roux has been contracted by Shrub Oak Partners LLC to provide environmental support.

The Scope of Work activities are as follows:

- Obtain necessary permits and approvals.
- Preparation and implementation of an approved Health and Safety Plan (HASP).
- Mobilization and demobilization
- Groundwater gauging and sampling of 9 monitoring wells.

If there are any changes with the scope a revision of the HASP will be required to address any new hazards.

4. Site Control

This Site control program is designed to reduce the spread of hazardous substances from contaminated areas to clean areas, to identify and isolate contaminated areas of the Site, to facilitate emergency evacuation and medical care, to prevent unauthorized entry to the Site, and to deter vandalism and theft.

4.1 Site Map

A map of this Site, showing Site boundaries, designated work zones, and points of entry and exit is provided in Figure 2.

4.2 Site Access

The Site is a public commercial shopping lot.

4.3 Buddy System

While working in the Exclusion Zone, Site workers use the buddy system. The buddy system means that personnel work in pairs and stay in close visual contact to be able to observe one another and summon rapid assistance in case of an emergency. The responsibilities of workers using the buddy system include:

- Remaining in close visual contact with partner;
- Providing partner with assistance as needed or requested;
- Observing partner for signs of heat stress, chemical overexposure or other difficulties;
- Periodically checking the integrity of partner's PPE; and
- Notifying the SS or other Site personnel if emergency assistance is needed.

4.4 Site Communications

The following communication equipment is used to support on-site communication:

Telephones – Mobile telephones will be carried by designated personnel for communication with emergency support services/facilities.

Radios – Two-way radios will be utilized onsite for communications between field personnel in areas where visual contact cannot be maintained and where hand signals cannot be employed.

Air Horn – Available as posted in the Site trailer or support zone to alert field personnel to an emergency situation. The emergency signal will be three sharp blasts of the air horn.

Hand Signals – This communication method will be employed by members of the field team along with use of the buddy system. Signals become especially important when in the vicinity of heavy moving equipment and when using Level B respiratory equipment. The signals shall become familiar to the entire field team before Site operations commence and will be reinforced and reviewed during Site-specific training.

As applicable, hand signals will be used according to the following:

Hand Signals

SIGNAL	MEANING
Hand gripping throat	Out of air; I cannot breathe
Grip partner's wrist	Leave area immediately
Hands on top of head	Need assistance
Thumbs up	I am all right; okay
Thumbs down	No; negative

A current list of emergency contact numbers is included in the Site-Specific Emergency Information at the beginning of this HASP and onsite in the Roux trailer.

4.5 Site Work Zones

Work areas at the Site will be divided into three (3) major zones, described below. These zones are characterized by the likely presence or absence of biological, chemical, or physical hazards and the activities performed within them. Zone boundaries are clearly marked at all times and the flow of personnel among the zones is controlled. The Site is monitored for changing conditions that may warrant adjustment of zone boundaries. Zone boundaries are adjusted as necessary to protect personnel and clean areas. Whenever boundaries are adjusted, zone markings are also changed and workers are immediately notified of the change.

Exclusion Zone

The area where contamination exists is the Exclusion Zone (EZ). All areas where excavation and handling of contaminated materials take place are considered part of the EZ. This zone will be clearly delineated by chain link fencing, caution tape, cones or other effective barriers, as necessary. Safety tape may be used as a secondary delineation within the EZ. The zone delineation markings may be opened in areas for varying lengths of time to accommodate equipment operation or specific construction activities. The SHSO may establish more than one EZ where different levels of protection may be employed or where different hazards exist. Personnel are not allowed in the EZ without:

- A buddy (co-worker);
- Required minimum level PPE;
- Medical authorization;
- Training certification; and
- Requirement to be in the zone.

Contamination Reduction Zone

A Contamination Reduction Zone (CRZ) is established between the exclusion zone and the support zone. The CRZ contains the Contamination Reduction Corridor (CRC) and provides an area for decontamination

of personnel and equipment. The CRZ will be used for general Site entry and egress in addition to access for heavy equipment and emergency support services. Personnel are not allowed in the CRZ without:

- A buddy (co-worker);
- Appropriate PPE;
- Medical authorization;
- Training certification; and
- Requirement to be in the zone.

Support Zone

The Support Zone (SZ) is an uncontaminated area that will be the field support area for the Site operations. The SZ will contain the temporary project trailers and provides for field team communications and staging for emergency response. Appropriate sanitary facilities and safety equipment will be located in this zone. Potentially contaminated personnel or materials are not allowed in this zone. The only exception will be appropriately packaged/decontaminated and labeled samples.

5. Job Hazard Evaluation

Roux's work at the Site is expected to entail a variety of physical, chemical, and biological hazards, all of which must be sufficiently managed to allow the work to be performed safely. Some of the hazards are Site-specific (i.e., they are associated with the nature, physical characteristics, and/or routine operation of the Site itself), while others are activity-specific (i.e., they are associated with [or arise from] the particular activity being performed). The various hazards can be grouped into the following categories:

- **Caught/Crushed** – the potential to become caught in, under, between, or by an object or parts of an object, such as equipment with parts that open and close or move up and down ("pinch points") or equipment that rotates, and the accompanying potential to have body parts cut, mangled, or crushed thereby.
- **Contact** – the potential to be struck by or against moving or stationary objects that can cause physical injury, such as heavy machinery, overhead piping, moving vehicles, falling objects, and equipment (including tools and hand-held equipment) or infrastructure with the ability to cut or impale.
- **Energy Sources** – the potential for bodily harm associated with energy sources, most notably electricity, but also including latent energy sources such as compressed air and equipment under tension (which when released could cause injurious contact or a fall).
- **Ergonomics** – the potential for musculoskeletal injury associated with lifting/carrying, pushing/pulling, bending, reaching, and other physical activity attributable to poor body position/mechanics, repetitive motion, and/or vibration.
- **Exposure** – the potential for injury/illness due to physical, chemical, or biological exposures in the work environment, including, but not limited to, temperature extremes, solar radiation, and noise (physical), chemical splashes and hazardous atmospheres (chemical), and animal/insect bites and poisonous plants (biological).
- **Falls** – the potential to slip or trip and thus fall or drop a load, resulting in bodily injury to oneself or others.

The foregoing is intended to provide Roux employees with a general awareness of the hazards involved with Site work. A more detailed review of the potential hazards associated with each specific activity planned for the Site (or on-going activity, as the case may be) is provided in the activity-specific Job Safety Analysis (JSA) forms in **Appendix A**. As can be seen in the JSA forms, the hazards are identified by category per the above, and specific measures designed to mitigate/manage those hazards are also identified. In preparing the JSA forms, all categories of hazards were considered, and all anticipated potential hazards were identified to the extent possible based on the experience of the personnel preparing and reviewing the JSA forms. However, there is always the possibility for an unanticipated hazard to arise, potentially as condition change over the course of the workday. Roux personnel must maintain a continual awareness of potential hazards in the work zone, regardless of whether the hazard is identified in the JSA form. Particular attention should be paid to hazards associated with exposure to hazardous substances (see **Table 1** for a listing of the hazardous substances most likely to be encountered in environmental media at the Site) and to Site personnel being located "in the line of fire" with respect to moving equipment, pinch points, and latent energy (e.g., being located or having body parts located within the swing radius of an excavator, between two sections of pipe being connected, below a piece of suspended equipment, or adjacent to a compressed air line).

5.1 Hazard Communication and Overall Site Information Program

The information in the JSAs and SDSs is made available to all employees and subcontractors who could be affected by it prior to the time they begin their work activities.

Modifications to JSAs are communicated during routine pre-work briefings, and periodically updated as needed in the HASP. SDSs will be maintained by the SHSO/SS for new chemicals brought on-site as needed. Copies of SDSs can be found in **Appendix B**.

5.2 Noise

Noise is associated with the operation of heavy equipment, power tools, pumps, and generators. Noise is also a potential hazard when working near operating equipment such as excavators, drill rigs or pole drivers. High noise (i.e., < 85 dBA) operations may be evaluated by the SHSO utilizing a type 2 handheld sound level meter (SLM) operating on the "A"-weighted scale with slow response because this scale most closely resembles human response to noise and complies with OSHA 29 CFR 1910.95. Hearing protection is required in areas with noise exposure greater than 85 dBA. Double hearing protection (ear plugs and earmuffs) should be donned in areas where the noise exposure is more than 95 dBA. Noise exposure will be controlled by hearing protection as described above or by maintaining set-backs from high-noise equipment, as warranted. Personnel handling heavy equipment and using power tools that produce noise levels exceeding those described levels above are required by OSHA 29 CFR 1910.95 to wear the appropriate Noise Reduction Rating (NRR) level of hearing protection. Appropriate hearing protection will be evaluated by the SHSO as necessary in consultation with the OHSM and CHSD.

5.3 Slip, Trip, and Fall Hazards

Slip, trip, and fall hazards may include, but are not limited to, general slip and trip hazards associated with uneven ground, possible debris, wet grass, and equipment. Prior to work, walking paths will be assessed for solid footings, any ground penetrations that may cause a tripping hazard will be appropriately marked, and other areas will be noted and discussed with the field team.

Personnel shall be aware of their surroundings and footings at all time, and all accommodations should be made for proper housekeeping and organized equipment placement at the Site, where possible, to help prevent any slip, trip, and fall-related incidents. All tools and materials should be appropriately stored when not in use and placed in appropriate storage containers.

5.4 Biological Hazards

Biological hazards that may potentially be present at a Site, include poisonous plants, insects (ticks, spiders, bees), animals (snakes, dogs), etc. Information on biological hazards can be found within Roux's Biological Hazard Awareness Management Program located within Roux's Corporate Health and Safety Manual. There is also potential for transmission and/or exposure to SARS-CoV-2, the virus that causes COVID-19. Prior to beginning work, on-Site protocols shall be established by the project team, including subcontractors, in accordance with federal, state, county, city, and/or other guidance, as applicable.

6. Emergency Response Plan

This emergency response plan details actions to be taken in the event of Site emergencies. The PM and SHSO is responsible for the implementation of emergency response procedures onsite. The SHSO/PM provides specific direction for emergency action based upon information available regarding the incident and response capabilities and initiates emergency procedures and notification of appropriate authorities. In the event of an emergency, Site personnel are evacuated and do not participate in emergency response activities, response is facilitated through external emergency services.

6.1 Emergency Response

The SHSO, after investigating the incident and relevant information, shall determine the level of response required for containment, rescue and medical care. Limited on-site emergency response activities could occur therefore the SHSO is responsible for notifying external emergency response agencies. The SHSO provides relevant information to the responding organizations, including, but not limited to, the hazards associated with the emergency incident, potential containment problems, and missing Site personnel.


6.2 Emergency Alerting and Evacuation

If evacuation notice is given, Site workers leave the worksite, if possible, by way of the nearest exit. Appropriate primary and alternate evacuation routes and assembly areas have been identified and are shown on the Site Plan with Emergency Muster Area (**Figure 2**). The routes and assembly area will be determined by conditions at the time of the evacuation based on wind direction, the location of the hazard source, and other factors as determined by SHSO/PM.

Personnel exiting the Site gather at a designated assembly point. To determine that everyone has successfully exited the Site, personnel will be accounted for at the assembly point. If any worker cannot be accounted for, notification is given to the SHSO, PM, and any arriving response authorities so that appropriate action can be initiated. Subcontractors on this Site have coordinated their emergency response plans to ensure that these plans are compatible and potential emergencies are recognized, alarm systems are clearly understood, and evacuation routes are accessible to all personnel relying upon them.

6.3 Emergency Medical Treatment and First Aid

In the event of a work-related injury or illness, employees are required to follow the procedures outlined below. All work-place injury and illness situations require Roux's Project and Corporate Management Team to be notified when an injury/illness incident occurs, and communication with the contracted Occupational Health Care Management Provider, WorkCare, Inc., is initiated, as necessary. The Injury/Illness Notification Flowchart is provided below and within Roux's Incident Investigation and Reporting program included within Roux's Corporate Health and Safety Manual.

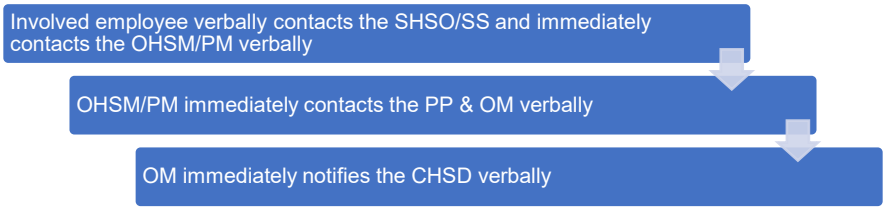

If on-Site personnel require any medical treatment, the following steps will be taken:

a. Notify Roux's Project and Corporate Management Team for any work-related injury and/or illness occurrence, and communicate with the contracted Occupational Health Care Management Provider, WorkCare, immediately following the notifications provided above.

b. Based on discussions with the Project Team, Corporate Management and the WorkCare evaluation, if medical attention beyond onsite first aid is warranted, transport the injured / ill person (IP) to the Urgent Care Center, or notify the Fire Department or Ambulance Emergency service and request an ambulance or transport the victim to the hospital, and continue communications with Corporate Management Team. An Urgent Care/Hospital Route map is included as **Figure 3**.

c. Decontaminate to the extent possible prior to administration of first aid or movement to medical or emergency facilities.

d. First aid medical support will be provided by onsite personnel trained and certified in First Aid, Cardio Pulmonary Resuscitation (CPR), Automatic External Defibrillation (AED), and Blood-Borne Pathogens (BBP) Awareness, until relieved by emergency medical services (EMS).

e. The SHSO and PM will perform a Loss Investigation (LI) and the Project Team will complete the final Loss Report. If a Roux employee is involved in a vehicular incident, the employee must also complete the Acord Automobile Loss Notice.

7. Environmental Conditions and Response

7.1 Adverse Weather Conditions

In the event of adverse weather conditions, the SHSO or project principal will determine if work can continue without jeopardizing the health and safety of field workers. Some of the items related to adverse weather conditions to be considered prior to determining if work should continue include:

- Potential for heat stress and heat-related injuries;
- Potential for cold stress and cold-related injuries;
- Treacherous weather-related conditions. If wind speed is greater than 15 mph averaged over a 15-minute period or wind gusts over 25 mph, earthmoving operations will be ceased
- Limited visibility; and
- Electrical storm potential.

Site activities will be limited to daylight hours and acceptable weather conditions. Inclement working conditions may include heavy rain, fog, high winds, and lightning. The SHSO and/or PM shall observe daily weather reports and evacuate, if necessary, in case of inclement weather conditions.

7.2 Electrical Storm Guidelines

In the event that lightning and/or thunder are observed while working onsite, all onsite activities shall stop and personnel shall seek proper shelter (e.g., substantial building, enclosed vehicle, etc.). Work shall not resume until the threat of lighting has subsided and no lightning or thunder has been observed for 30 minutes. If the possibility of lightning is forecast for the day, advise the onsite personnel on the risks and proper procedure at the pre-work safety briefing. Continuously monitor for changing weather conditions and allow enough time to properly stop work if lightning is forecast.

7.3 Environmental Stressors, Heat Stress, Heat Exhaustion, and Heat Stroke

It is the employer's responsibility to monitor weather forecasts and ambient air temperatures, both prior to the work shift and during the shift.

To prevent potential heat illness, the following strategies will be implemented:

- Adjusting personnel work/rest intervals;
- Monitoring for symptoms of heat illness;
- Providing shaded rest areas;
- Providing cool potable water so that each employee has access to at least one quart per hour for the entire shift, free of charge;
- Allowing for employees to acclimatize to the weather conditions and work demands;
- Observe workers during a heat wave (i.e., when the temperature is at least 80oF, and 10 degrees hotter than the average temperature of the five preceding days); and
- Implementing high heat procedures when the temperature reaches 95oF.

Roux's Heat Illness Prevention Plan is implemented when the when ambient temperatures exceed 80oF. Roux's Heat Illness Prevention Program can be found within **Appendix C**. Additional information regarding heat illnesses is provided below. This can include, but is not limited to, access to shade that is sufficient in size to fit all workers who are on break; a car with air conditioning is acceptable, too. Preventative cool-down breaks shall be allowed at any time, and anyone taking such a break will be monitored for heat illness symptoms and not required to return to work until all symptoms (if present) of heat illness have disappeared. If necessary, first aid will be offered, but if symptoms are severe, emergency response procedures will be implemented per Section 6.3. Anyone who has shown symptoms of severe heat illness will not be sent home without being offered first aid or medical treatment.

High heat procedures must be implemented when temperatures reach 95oF. These procedures include:

- Ensuring that effective communication by voice, observation, or electronic means is maintained so that employees at the work site can contact a supervisor when necessary. An electronic device, such as a cell phone or text messaging device, may be used for this purpose only if the reception in the area is reliable.
- Observing employees for alertness and signs or symptoms of heat illness. The employer shall ensure effective employee observation/monitoring by implementing one or more of the following:
    - Supervisor or designee observation of 20 or fewer employees;
    - Mandatory buddy system; and
    - Regular communication with sole employee such as by radio or cellular phone, or other effective means of observation.
- Designating one or more employees on each worksite as authorized to call for emergency medical services and allowing other employees to call for emergency services when no designated employee is available.
- Encouraging employees throughout the work shift to drink plenty of water.
- A review of the high heat procedures during the daily tailgate meeting and remind employees of their right to take a cool-down rest when necessary.

7.3.1 Heat Stress

Heat stress is the body's response to excessive heat and can be a significant potential hazard. The risk of heat stress can be increased with heavy physical activity and/or the use of personal protective equipment in hot, humid weather environments. There are also personal risk factors that can contribute to the risk of suffering from heat stress, such as obesity, water intake, alcohol and caffeine consumption, pregnancy, age, medication, etc. Heat illness includes heat cramps, heat exhaustion, heat syncope, and heat stroke.

7.3.2 Heat Cramps

Heat cramps may be brought on by prolonged exposure to heat. As an individual sweats, water and salts are lost by the body resulting in painful muscle cramps, typically in the legs.

First aid treatment includes, but is not limited to, shade, rest, and fluid replacement. Typically, the individual should recover within one-half hour while being monitored constantly. If the individual has not improved substantially within 30 minutes and the body temperature has not decreased, the individual should be transported to a hospital for medical attention.

Per Roux's Heat Illness Prevention Plan, employees shall have access to potable drinking water that is fresh, pure, suitably cool, free of charge and in sufficient quantities. Access to shade shall be present when temperatures exceed 80 degrees Fahrenheit and shall be available when temperatures do not exceed 80 degrees Fahrenheit.

7.3.3 Heat Exhaustion

Heat exhaustion may occur in an individual who has been exposed to excessive heat while working or exercising. The circulatory system of the individual fails as blood collects near the skin to rid the body of excess heat through transference. The signs and symptoms of heat exhaustion are as follows:

- Rapid and shallow breathing;
- Weak pulse;
- Cold and clammy skin with heavy perspiration;
- Skin appears pale;
- Fatigue and weakness;
- Dizziness; and
- Elevated body temperature.

First aid treatment includes, but is not limited to, cooling the victim, elevating the feet, and replacing fluids.

If the individual is not substantially improved within 30 minutes and the body temperature has not decreased, the individual should be transported to the hospital for medical attention.

7.3.4 Heat Stroke

Heat stroke occurs when an individual is exposed to excessive heat and stops sweating. This condition is classified as a MEDICAL EMERGENCY requiring immediate cooling of the victim and transport to a medical facility. The signs and symptoms of heat stroke are as follows:

- Dry, hot, red skin;
- Body temperature approaching or above 105oF;
- Confusion, altered mental state, slurred speech;
- Seizures;
- Large (dilated) pupils; and
- Loss of consciousness – the individual may go into a coma.

First aid treatment requires immediate cooling and transportation to a medical facility. Heat stress is a significant hazard if any type of protective equipment (semi-permeable or impermeable) that prevents evaporative cooling when worn in hot weather environments.

7.4 Cold Stress

Cold stress is a danger at low temperatures and when the wind-chill factor is low. Prevention of cold-related illnesses is a function of whole-body protection. Adequate insulating clothing must be used when the air temperature is below 60°F. A work/rest regimen will be initiated when ambient temperatures and protective

clothing cause a stressful situation. In addition, reduced work periods followed by rest in a warm area may be necessary in extreme conditions. The signs and symptoms of cold stress include the following:

- Severe shivering;
- Abnormal behavior;
- Slowing;
- Weakness;
- Stumbling or repeated falling;
- Inability to walk;
- Collapse; and/or
- Unconsciousness.

First aid requires removing the victim from the cold environment and seeking medical attention immediately. Also, prevent further body heat loss by covering the victim lightly with blankets. Do not cover the victim's face. If the victim is still conscious, administer hot drinks and encourage activity such as walking, wrapped in a blanket.

8. Safety Procedures

This section of the HASP presents the specific safety procedures to be implemented during Roux's activities at the Site in order to protect the health and safety of various on-site personnel. Minimum OSHA-mandated procedures are presented first, followed by client- and Site-specific procedures. Lastly, activity-specific procedures are discussed. These Site and activity-specific procedures supplement the general safety procedures included in Roux's Corporate Health and Safety Manual, which also must be followed in their entirely.

8.1 Training

At a minimum, Site personnel who will perform work in areas where there exists the potential for toxic exposure will be health and safety-trained prior to performing work onsite per OSHA 29 CFR 1910.120(e) and 29 CFR 1926.65(e). More specifically, all Roux, subcontractor, and other personnel engaged in sampling and remedial activities at the Site and who are exposed or potentially exposed to hazardous substances, health hazards, or safety hazards must have received at a minimum the 40 hour initial HAZWOPER training consistent with the requirements of 29CFR 1910.120(e)(3)(i) training and a minimum of 3 days' actual field experience under the direct supervision of a trained experienced supervisor, plus 8 hours of refresher training on an annual basis. Depending on tasks performed, less training may be permitted. Evidence of such training must be maintained at the Site at all times. Furthermore, all on-Site management and supervisory personnel directly responsible for or who supervise the employees engaged in Site remedial operations, must have received an additional 8 hours of specialized training at the time of job assignment on topics including, but not limited to, the employer's safety and health program and the associated employee training program, personal protective equipment program, spill containment program, and health hazard monitoring procedure and techniques, plus 8 hours of refresher training on an annual basis. Additionally, all workers who will be required to don a respirator will be properly trained on their employer's Respiratory Protection Program, which also includes being medically cleared to wear a respirator and passed a fit test, at least initially prior to use, and then annually thereafter in accordance with 29 CFR 1910.134, Respiratory Protection.

Roux personnel training records are maintained in a corporate database with records available upon request from either the OHSM/SHSO/CHSD or Human Resources Department.

8.2 Site-Specific Safety Briefings for Visitors

A site-specific briefing is provided to all site visitors who enter this site beyond the site entry point. For visitors, the site-specific briefing provides information about site hazards, the site lay-out including work zones and places of refuge, the emergency alarm system and emergency evacuation procedures, and other pertinent safety and health requirements as appropriate.

8.3 HASP Information and Site-Specific Briefings for Workers

Site personnel review this HASP and are provided a Site-specific tailgate briefing prior to the commencement of work to ensure employees are familiar with this HASP and the information and requirements it contains, as well as the relevant JSAs included in **Appendix A**. Additional briefings are provided as necessary to notify employees of any changes to this HASP as a result of information gathered during on-going Site characterization and analysis of changing conditions. Conditions for which we

schedule additional briefings include, but are not limited to: changes in site conditions, changes in the work schedule/plan, newly discovered hazards, and incidents occurring during Site work.

8.4 Medical Surveillance

The medical surveillance section of the Health and Safety Plan describes how worker health status is monitored at this site. Medical surveillance is used when there is the potential for worker exposure to hazardous substance at levels above OSHA Permissible Exposure Limits (PEL) or other published limits. The purpose of a medical surveillance program is to medically monitor worker health to ensure that personnel are not adversely affected by site hazards. The provisions for medical surveillance at this site are based on the site characterization and job hazard analysis found in Section 4 of this HASP and are consistent with OSHA requirements in 29 CFR 1910.120(f) as applicable.

8.4.1 Site Medical Surveillance Program

Medical surveillance requirements are based on a worker's potential for exposure as determined by the site characterization and job hazard analysis documented in Section 4 and JSAs within **Appendix A** of this HASP and in compliance with the requirements of 29 CFR 1910.120(f)(2). Based on site information and use of direct reading instruments, limited use of respirators (less than 30 days per year), and the absence of an employee-staffed HAZMAT team, a limited medical surveillance program is required and implemented at this site. The medical surveillance program provides that:

1. Workers assigned to tasks requiring the use of respirators receive medical examinations in accordance with 29 CFR 1910.134(e) to ensure they are physically capable to perform the work and use the equipment, and
2. If a worker is injured, becomes ill, or develops signs or symptoms of possible over-exposure to hazardous substance or health hazards, medical examinations are provided to that worker as soon as possible after the occurrence and as required by the attending physician.
3. These medical examinations and procedures are performed by or under the supervision of a licensed physician and are provided to workers free of cost, without loss of pay, and at a reasonable time and place. In addition, the need to implement a more comprehensive medical surveillance program will be re-evaluated after any apparent over-exposure.

8.4.2 Medical Recordkeeping Procedures

Medical recordkeeping procedures are consistent with the requirements of 29 CFR 1910.1020 and are described in the company's overall safety and health program. A copy of that program is available at our Islandia, New York office.

The following items are maintained in worker medical records:

- Respirator fit test and selection;
- Physician's medical opinion of fitness for duty (pre-placement, periodic, termination);
- Physician's medical opinion of fitness for respirator protection (pre-placement, periodic); and
- Exposure monitoring results.

8.4.3 Program Review

The medical program is reviewed to ensure its effectiveness. The Corporate Health and Safety Manager, in coordination with the Human Resources Director, is responsible for this review. At minimum, this review consists of:

- Review of accident and injury records and medical records to determine whether the causes of accidents and illness were promptly investigated and whether corrective measures were taken wherever possible;
- Evaluation of the appropriateness of required medical tests based on site exposures; and
- Review of emergency treatment procedures and emergency contacts list to ensure they were site specific, effective, and current.

8.5 Personnel Protection

Site safety and health hazards are eliminated or reduced to the greatest extent possible through engineering controls and work practices. Where hazards are still present, a combination of engineering controls, work practices and PPE are used to protect employees. Appropriate personal protective equipment (PPE) shall be worn by Site personnel when there is a potential exposure to chemical, biological or physical hazards (e.g., falling objects, flying particles, sharp edges, electricity, and noise), as determined by the SHSO. The level of personal protection, type and kind of equipment selected will depend on the hazardous conditions and in some cases cost, availability, compatibility with other equipment, and performance. An accurate assessment of all these factors will be made before work can be safely executed.

Roux maintains a comprehensive written PPE program that addresses proper PPE selection, use, maintenance, storage, fit and inspection. Roux's PPE program can be found within **Appendix D**. PPE to be used at the Site will meet the appropriate American National Standards Institute (ANSI) standards and the following OSHA (General/Construction Industry) standards for minimum PPE requirements.

The minimum level of PPE for entry onto the Site is Level D. The following equipment shall be worn:

- Work uniform (long pants, sleeved shirt);
- Hard hat;
- Steel or composite toe work boots (must comply with American Society for Testing and Materials [ASTM]) F 2412-05, Standard Test Methods for Foot Protection and ASTM F 2413-05, Standard Specification for Performance Requirements for Foot Protection);
- Safety Glasses (must comply with one of the following ANSI/ISEA Z87.1-2010, ANSI Z87.1-2003, ANSI Z87.1-2003);
- Boot Covers (as needed);
- Hearing protection (as needed);
- High visibility clothing (shirt/vest); and
- Hand protection (e.g., minimum cut resistance meeting ANSI 105-2000 Level 2).

Note that jewelry shall be removed or appropriately secured to prevent it from becoming caught in rotating equipment or unexpectedly snagged on a fixed object (e.g., wrist watches, bracelets, rings, chains and necklaces, open earrings). Do not wear loose clothing and all shoulder-length hair should be tied back.

Site specific PPE ensembles and materials are identified within task specific JSAs located within **Appendix A**, and any upgrades or downgrades of the level of protection (i.e., not specified in the JSA) must be approved by the PP and immediately communicated to all Roux personnel and subcontractors as applicable. PPE is used in accordance with manufacturer's recommendations.

8.5.2 Hearing Conservation

Hearing protection is made available when noise exposures equal or exceed an 8-hour time-weighted average sound level of 85 dBA. Hearing protection is required when the 8-hour time weighted average sound level > 85 dBA, or when noise levels exceed 140 dBA at any point or exceeds 115 dBA for at least 15 minutes. Where noise exposure meets or exceeds this level, noise is listed as a physical hazard in the JSA for the tasks/operation, and hearing protection is included as one of the control measures (PPE).

8.6 Monitoring

An air monitoring program is important to the safety of on- and off-Site personnel, and the surrounding area. A preliminary survey, to establish background conditions in the immediate sampling area, may be made prior to the initiation of Site work including, but not limited to, monitoring wind direction (e.g., wind socks) and approximate temperature during all invasive Site activities. This survey will be conducted with the appropriate pre-calibrated air monitoring instrument(s), as warranted by the field activity. Once this survey has been complete, any changes in the type of PPE will be determined and relayed to those working on Site.

Work zone air monitoring will be performed to verify that the proper level of PPE is used, and to determine if increased protection or work stoppage is required. The following equipment shall be used to monitor conditions:

- A Photoionization Detector (PID) with a lamp energy of 10.6 eV will be used to provide direct readings of organic vapor concentrations during intrusive activities to determine that personnel protection is adequate. Concentrations shall be recorded during intrusive activities with the potential to encounter contaminant vapors.
- Colorimetric detection tubes shall be used based on PID action levels to qualitatively identify possible contaminants as applicable.
- A pre-calibrated multi-gas meter with combustible Lower Explosive Limit (LEL), oxygen (O2), carbon monoxide (CO), and hydrogen sulfide (H2S) sensors shall be used to monitor the potential for oxygen-deficient atmospheres, explosive concentrations of organic vapors, and toxic gases during intrusive operations. The calibration for this device will be performed using a known gas composition calibration mixture.

Personal exposure monitoring utilizing activated charcoal tubes may be considered based on whether or not the area sample results are at or above half of the PEL. The decision to perform the monitoring will be made by, and under the control of, the CHSD.

Below are monitoring action levels for Site-specific chemicals of concern. In the event PID readings above the thresholds identified below are sustained for 5 minutes in the breathing zone, worker protection will require upgrading following notification to the OHSM and applicable parties.

8.6.1 Action Levels for Air Monitoring

PPE can remain at Level D if breathing zone VOC concentrations are less than 5 ppm and benzene is non detect. Personnel are required to evacuate the Site when breathing zone VOC readings exceed 25 ppm.

The following tables include summaries of the air monitoring, work practices, and action levels for the expected contaminants. The action levels to initiate testing with colorimetric tubes for airborne volatiles is 1 ppm (PID reading) and is based on the Permissible Exposure Limit (PEL) for benzene (1 ppm). The colorimetric tubes are used to confirm the presence or absence of specific constituents, and they do not provide a measured concentration.

PPE can remain at Level D if breathing zone VOC concentrations are less than 5 ppm, is non-detect. Personnel are required to evacuate the Site when breathing zone VOC readings exceed 25 ppm.

The following tables include summaries of the air monitoring, work practices, and action levels for the expected contaminants.

Air Monitoring Summary and Action Levels Organic Vapors	
PID Reading in Breathing Zone (ppm)	**Action**
0-1 ppm above background	Continue monitoring
>1-5 ppm sustained 60 seconds	Continue monitoring
<5 ppm	Continue Monitoring, ventilate space
≥ 5 ppm - ≤ 25 ppm	Ventilate space until PID reads < 5 ppm. If < 5 ppm cannot be achieved, upgrade to Level C[1].
≥ 25 ppm	Ventilate space and evacuate area. Consult with CHSD.

Background concentrations should be established at the beginning of each work day. It may be necessary to re-establish background concentrations and ambient conditions vary through the day.

1 Measured air concentrations of known organic vapors will be reduced by the respirator to one half of the PEL or lower, and the individual and combined compound concentrations shall be within the service limit of the respirator cartridge.

Air Monitoring Summary and Action Levels Oxygen	
O_2 Reading in Breathing Zone (%)[1]	**Action**
20.9% O_2	Oxygen level normal
< 19.5% O_2	Oxygen deficient Interrupt task/Evacuate area
>23.5% O_2	Oxygen enriched Interrupt task/Evacuate area

1. Action levels based on USEPA Standard Operating Safety Guides; Table 5-1

Air Monitoring Summary and Action Levels Carbon Monoxide	
CO Reading in Breathing Zone (ppm)[1]	**Action**
<12.5 ppm	Inspect exhaust system for leaks or other sources of CO. Monitor initially and every 15 minutes during use of CO-generating equipment.

Air Monitoring Summary and Action Levels Carbon Monoxide	
12.5-25 ppm	Ventilate area. Monitor continuously and record measurements. Contact PM.
>25 ppm	Cease Field Operations. Ventilate area.

1. Based upon the American Conference of Governmental Industrial Hygienists (ACGIH) Threshold Limit Value (TLV) of 25 ppm as an 8-hour time weighted average (TWA) and OSHA's Permissible Exposure Limit (PEL) of 50 ppm as an 8-hour TWA concentration.

Air Monitoring Summary and Action Levels Combustible Gases	
Lower Explosive Limit (LEL) Reading	**Action**
< 4% LEL	Site activities will continue with normal monitoring
4% – 20% LEL	Stop work until levels dissipate to <4% LEL
> 20% LEL	Potential explosion hazard. Halt all site activities, research source of release, aerate work area, suppress source.
Air Monitoring Summary and Action Levels Hydrogen Sulfide	
Hydrogen Sulfide (H_2S) Reading	**Action**
<10 ppm	Site activities will continue with normal monitoring
≥10 ppm	Stop work until levels dissipate to <10 ppm; use mechanical ventilation if possible. Consult with CHSD if unable to reduce concentrations below 10 ppm.

8.6.2 Explosive Hazard

Methane is a common gas constituent that is generated during the decomposition of organics. Methane, a non-toxic compound, does not have an OSHA PEL or other exposure limits based on toxicity; however, methane is explosive under certain conditions. The Lower Explosive Limit (LEL) for methane is 5% in air, or 50,000 parts per million by volume. At high concentrations, methane can also displace oxygen and cause asphyxiation. Since methane is lighter than air, it does not tend to accumulate in low-lying areas and will rapidly mix with atmospheric air if encountered during drilling activities. Methane concentrations will be continuously monitored using a pre-calibrated gas meter while excavation takes place.

8.6.3 Air Monitoring Equipment and Calibration

A PID calibrated to an appropriate calibration mixture will be used to detect organic vapors in and around the work areas. Monitoring will be conducted in and around all work areas and at the workers breathing zone before activities commence to establish a background level, then at 15-minute intervals throughout the day. All equipment will be calibrated according to the manufacturer's recommendation. A calibration log will be maintained and will include the name of the person who performed the calibration, the date and time calibrated, and the instrument reading at the time of calibration. A manual bellows pump or equivalent

with colorimetric tubes for specific compounds will be utilized to determine the course of action related to upgrading or downgrading the level of respiratory protection, as applicable.

If air monitoring data indicate safe levels of potentially harmful constituents at consistent intervals (5-minute intervals), then monitoring can be conducted less frequently (every 30 minutes). This determination will be made by the onsite SHSO. Monitoring data, including background readings and calibration records, will be documented. Work to be performed on-Site will conform to Roux's Standard Operating Procedures (SOPs). Conformance with these guidelines as well as the guidelines described in this HASP will aid in mitigating the physical and chemical hazards mentioned throughout this HASP.

8.7 Tailgate Safety Meetings

A designated Site worker will provide daily safety briefings (e.g., tailgate meetings) including, but not limited to, the following scenarios:

- When new operations are to be conducted;
- Whenever changes in work practices must be implemented; and
- When new conditions are identified and/or information becomes available.

Daily safety briefings shall be recorded on the Roux Daily Tailgate Health and Safety Meeting Log/Daily Site Safety Checklist, and all completed forms will become a part of the project file.

8.8 Spill Containment

Spill containment equipment and procedures should, at a minimum, meet the requirements of the facility's Spill Prevention, Control and Countermeasure Plan, if applicable. Otherwise, spill containment equipment and procedures must be considered depending on the task, including, but not limited to, chemical/product transfer points and handling.

8.8.1 Initial Spill Notification and Response

Any worker who discovers a hazardous substance spill will immediately notify the SHSO. The worker will, to his/her best ability, report the hazardous substance involved, the location of the spill, the estimated quantity of material spilled, the direction/flow of the spill material, related fire/explosion incidents, and any associated injuries without compromising their own safety.

8.8.2 Spill Evaluation and Response

The SHSO is responsible for evaluating spills and determining the appropriate response. When this evaluation is being made, the spill area will be isolated and demarcated to the extent possible. If necessary to protect nearby community members, notification of the appropriate authorities is made by the PM as appropriate. On-Site response is limited to small spills (e.g., <10 gallons); large spills require external emergency responders who will be contacted by the SHSO.

8.9 Decontamination

The decontamination section of the HASP describes how personnel and equipment are decontaminated when they leave the Exclusion Zone. This section also describes how residual waste from decontamination processes is disposed. The site decontamination procedures are designed to achieve an orderly, controlled removal or neutralization of contaminants that may accumulate on personnel or equipment. These

procedures minimize worker contact with contaminants and protect against the transfer of contaminants to clean areas of the site and off-site. They also extend the useful life of PPE by reducing the amount of time that contaminants contact and can permeate PPE surfaces. Decontamination is facilitated within the CRZ at this site, if applicable.

8.9.1 Decontamination Procedures for Personnel and PPE

The following are general decontamination procedures established and implemented at this site.

1. Decontamination is required for all workers exiting a contaminated area. Personnel may re-enter the SZ only after undergoing the decontamination procedures described below in the next section.
2. Protective clothing is decontaminated, cleaned, laundered, maintained and/or replaced as needed to ensure its effectiveness.
3. PPE used at this site that requires maintenance or parts replacement is decontaminated prior to repairs, or
4. PPE used at this site is decontaminated or prepared for disposal on the premises. Personnel who handle contaminated equipment have been trained in the proper means to do so to avoid hazardous exposure.
5. This site uses an off-site laundry for decontamination of PPE. The site has informed that facility of the hazards associated with contaminated PPE from this site.
6. The site requires and trains workers that if their permeable clothing is splashed or becomes wetted with a hazardous substance, they will immediately exit the work zone, perform applicable decontamination procedures, shower, and change into uncontaminated clothing.
7. Procedures for disposal of decontamination waste meet applicable local, State, and Federal regulations.

8.9.2 Decontamination Procedures for Equipment

All tools, equipment, and machinery from the EZ or CRZ are decontaminated in the CRZ prior to removal to the SZ. Equipment decontamination procedures are designed to minimize the potential for hazardous skin or inhalation exposure and to avoid cross-contamination and chemical incompatibilities.

General Equipment Decontamination Procedures:

1. Decontamination is required for all equipment exiting a contaminated area. Equipment may re-enter the SZ only after undergoing the equipment decontamination procedures.
2. Vehicles that travel regularly between the contaminated and clean areas of the site are carefully decontaminated each time they exit the EZ and the effectiveness of that decontamination is monitored to reduce the likelihood that contamination will be spread to other parts of the site.
3. Particular attention is given to decontaminating tires, scoops, and other parts of heavy equipment that are directly exposed to contaminants and contaminated soil.
4. Procedures for disposal of decontamination waste shall meet applicable local, State, and Federal regulations.

The following items may be used to decontaminate equipment:

- Fresh water rinse;
- Non-phosphorus detergent wash;
- Acetone rinse;
- Distilled water rinse; and

- A steam cleaner or pressure washer (heavy equipment only).

8.9.3 Monitoring the Effectiveness of Decontamination Procedures

Visual examination and sampling are used to evaluate the effectiveness of decontamination procedures. Visual examination is used to ensure that procedures are implemented as described and that they appear to control the spread of contaminants under changing site conditions. Visual examination is also used to inspect for signs of residual contamination or for contaminant permeation of PPE.

Personnel who work in contaminated areas of the site, either the Contamination Reduction Zone (CRZ) or the Exclusion Zone, are trained in the principles and practices of decontamination described in this section of the HASP and in related SOPs. If site procedures are changed as a result of inspection and monitoring, all affected employees are notified of these changes.

8.10 Confined Space Entry

Roux and its subcontractors will not be performing any confined space work. Should there be any changes to the scope of work this HASP will be updated. The following is a list of the safety requirements for confined space entry at the Site:

- **ROUX PERSONNEL ARE NOT AUTHORIZED TO ENTER AN OSHA PERMIT REQUIRED CONFINED SPACE;**
- Currently the scope of work **DOES NOT** require personnel to enter permitted confined space for this project; and
- Any changes to the field activities that may necessitate confined space entry will be reported to the Project Principal and OHSM.

Confined space is defined as any space, depression, or enclosure that:

- Has limited opening for entry and egress;
- Is large enough for and employee to enter and perform assigned work; and
- Is not intended for continuous occupancy.

A permit required confined space is one that meets the definition of a confined space and has one or more of the following characteristics:

- May contain or produce life-threatening atmospheres due to oxygen deficiency the presence of toxic, flammable, or corrosive contaminants;
- Contains a material that has the potential for engulfment;
- Has an internal configuration that may cause an entrant to be trapped or asphyxiated by inwardly converging walls or by a floor that slopes downward and tapers to a smaller cross-section; and
- Contains any other serious safety or health hazards.

Although Roux personnel will not perform confined space entry, it is expected that subcontractors performing cleaning and mitigation and/or remedial measures activities may be required to enter structures that are considered to be a permit required confined space. Permitting of the confined space as well as hazard mitigation for entry will be completed by the subcontractor in accordance with 29 CFR 1910.146 or 1926.1201-1213 and/or applicable local/client requirements.

8.11 Client and Site-Specific

In addition to the OSHA-specific procedures discussed above, there may be client and site-specific safety procedures that must be adhered to during the performance of remedial activities at the Site.

8.12 Unusual or Significant Risks

Field activities that appear to have unusual or significant risks that cannot be adequately managed with existing risk tools such as LMRAs, HASPs, traffic safety plans, work permits, design and O&M practices, equipment HAZOPS or other safety tools must be referred to the CHSD to help with the assessment and management of the associated potential safety risks. Examples include the use of explosives for demolition, use of firearms to control wildlife, rappelling, demolition over water, diving, etc.

8.13 Activity-Specific Hazards

In addition to the general hazards discussed above, there are activity-specific hazards associated with each work activity planned for the Site. An activity-specific JSA has been completed for each of the activities planned for the Site. JSAs are provided in **Appendix A**. In the event that new work activities or tasks are planned, JSAs will be developed and implemented prior to performing the new activities. In the absence of a JSA, the personnel performing work must prepare a field JSA and receive clearance from a designated competent safety official prior to performing any task with significant risk. In emergency situations where time is critical, Risk Assessments (LMRAs) will be utilized to identify the task, associated hazards and mitigative actions to take. For lower risk activities (as deemed by the discretion of a Competent Person) where a JSA is determined to not be needed, the individual(s) conducting the activities must perform LMRAs prior to and during the work.

8.13.1 Electrical and Other Utility Assessment and Accommodations

Roux shall perform a site walk to identify any potential overhead electrical or utility lines. All applicable guidelines will be followed in the vicinity of overhead power and utility lines (see Section 8.13.3 below).

Roux has also reviewed all available Site maps showing buried utility lines to identify potential hazards; the review revealed no underground hazards are known to exist in the vicinity of the areas of the Site pertinent to this HASP.

8.13.2 Subsurface Work

Subsurface work activities will require adherence to Roux's Corporate Subsurface Utility Clearance Management program found within Appendix E.

8.13.2.1 Excavations and Trenching

Trenching and excavation work activities carried out by Roux and their subcontractors shall comply with applicable OSHA standards (i.e., 29 CFR 1926.650-652). Regional Notification Centers (i.e., Underground Services Alert) shall be notified at least two working days prior to the start of any digging or excavation work per state requirements (i.e., 811-One Call). Personnel responsible for excavation activities will be trained in their job responsibilities. Additionally, for trenches 4 feet or deeper, where employees will enter, the trench needs to have a stairway, ladder or other safe means of egress, and located so that employees do not have to travel farther than 25 feet horizontally. Where employees will enter trenches greater than 5 feet

deep, the trench must have some type of protective system or sloped sidewalls appropriately to prevent cave-ins.

The SHSO or other responsible Roux personnel will be present on-Site during all Roux contracted excavation and backfill operations and will supplement health and safety monitoring conducted by Subcontractor air quality screening to ensure that appropriate levels of protection and safety procedures are utilized. The proximity of chemical, water, sewer, and electrical lines will be identified by Roux and/or their subcontractor before any subsurface activity or sampling is attempted. Prior to any excavation activities, trees, shrubbery, and other objects that can potentially pose as a hazard during excavation should be supported or removed from the excavation area. The following safe work practices will be implemented during this task.

- The proximity of chemical, water, sewer, and electrical lines will be identified by a facility representative prior to beginning any subsurface activity;
- At the start of every day, a competent person will inspect excavations to evaluate if the area is stable and safe to enter. Inspections will be conducted as needed throughout the excavation operations. If deemed necessary, a competent person may also conduct inspections after rainfall or any other event that can potentially affect the integrity of the excavation. Employees will not enter excavations where water has accumulated until protective measures have been implemented.
- Prior to entering excavations greater than 4 feet in depth, air monitoring for oxygen and hazardous atmospheres must be conducted to assure atmospheric conditions are within normal levels described in Section 8.6. Continuous air monitoring with a standard multi-gas detector (O2, LEL%, CO, H2S) shall be used during the course of work within an excavation; if action limits are reached workers shall safely exit the excavation. Upgrades to worker protection should be evaluated with the SHSO and PP in consultation with the CHSD. Emergency rescue equipment, such as breathing apparatuses and safety harnesses connected to an extraction device, will be readily available in the event of hazardous atmospheric conditions;
- While earthmoving, stay out of the excavator's delineated heavy equipment exclusion zone and away from the excavation sides where there is potential for cave in (within excavations that are 6 feet or more in depth, a delineated perimeter 6 feet away from the excavated edge is required);
- During loading and unloading operations, stand away from haul trucks and other vehicles to avoid contact with any falling loads; and
- Traffic cones, caution tape, or other barriers will be set up around the perimeter of the excavation when employees are working along the excavation edge and for any excavation that will be left open overnight or unattended for more than two days.

Maximum Allowable Slopes

Soil or Rock Type	Maximum Allowable Slopes (H:V)[1] for Excavations Less Than 20 Feet Deep[3]
Stable Rock	Vertical (90°)
Type A[2]	3/4 : 1 (53°)
Type B	1 : 1 (45°)
Type C	1 1/2 : 1 (34°)

29 CFR 1926 Subpart P Appendix B Sloping and Benching Table B-1

Notes:

[1] Numbers shown in parentheses next to maximum allowable slopes are angles expressed in degrees from the horizontal. Angles have been rounded off.

Maximum Allowable Slopes

Soil or Rock Type	Maximum Allowable Slopes (H:V)[1] for Excavations Less Than 20 Feet Deep[3]

[2] A short-term maximum allowable slope of $^{1}/_{2}$H : 1V (63°) is allowed in excavations in Type A soil that are 12 feet (3.67 meters) or less in depth. Short-term maximum allowable slopes for excavations greater than 12 feet (3.67 meters) in depth shall be $^{3}/_{4}$H : 1V (53°).

[3] Sloping or benching for excavations greater than 20 feet deep shall be designed and stamped by a registered professional engineer.

Proper stockpiling (i.e., 2 feet minimum distance from the excavation edge), containment, transport, storage, and disposal practices will be utilized and is dependent upon the potential type and amount of waste generated during operations. The location of safety equipment and evacuation procedures will be established prior to initiation of operations according to this HASP.

8.13.3 Heavy Equipment

Use of heavy equipment at the Site will require adherence to Roux's Corporate Heavy Equipment Exclusion Zone Management Program found within Appendix F. Additionally, operation of the drill rig/other heavy equipment will maintain clearances from overhead power lines in accordance with 29 CFR 1926.1408 Table A Minimum Clearance Distances provided below.

Minimum Required Clearances for Energized Overhead Power Lines

Nominal System Voltage of Power Line (K V)	Minimum Required Clearance (feet)
0-50	10
51-100	12
101-200	15
201-300	20
301-500	25
501-750	35
751-1000	45

1 kilovolt (KV) = 1,000 volts

8.14 Traffic Control

If Site operations encroach upon public streets or highways and a hazard exists to Site personnel because of traffic conditions, a traffic control plan will be implemented in accordance with the United States Department of Transportation's (DOT's) "Manual on Uniform Traffic Control Devices."

8.15 Sanitation

Sanitation facilities will be provided in accordance with the sanitation standards (29 CFR 1910.141, 29 CFR 1926.51 and 29 CFR 1928.110). Sanitation facilities will be maintained and kept in good conditions at all times.

9. Field Team Review

Each person performing work at or visiting this site shall sign this section after site-specific training is completed and before being permitted to access the CRZ or Exclusion Zone.

I have read and understand this Site-Specific Health and Safety Plan. I will comply with the provision contained therein.

Site/Project: Mr. Cleaners – Shrub Oak Shopping Center Site

Name & Company	Signature	Date

10. Approvals

By their signature, the undersigned certify that this HASP is approved and will be utilized at the Shrub Oak Facility Site.

Michelle Okvist – Site Health and Safety Officer	Date
Nevin Pahlad – Office Health and Safety Manager	Date
Camila Israel – Project Manager	Date
Frank Cherena – Project Principal	Date

TABLES

1. Toxicological Properties of Hazardous Substances Present at the Site

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at 1360 E Main Street, Shrub Oak, New York.

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
ORGANOCHLORINE PESTICIDES (OCP)									
DDT	50-29-3	TWA 1 mg/m3	TWA 0.5 mg/m3	TWA 1 mg/m3	500 mg/m3	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin; paresthesia tongue, lips, face; tremor; anxiety, dizziness, confusion, malaise (vague feeling of discomfort), headache, lassitude (weakness, exhaustion); convulsions; paresis hands; vomiting; [potential occupational carcinogen]	Eyes, skin, central nervous system, kidneys, liver, peripheral nervous system	White, odorless and tasteless, very stable, water-insoluble, synthetic BP: 260°F Fl.Pt. = 162-171°F LEL: NA UEL: NA
Aldrin	309-00-2	TWA 0.1 mg/m3	TWA 0.25 mg/m3	TWA 0.25 mg/m3	25 mg/m3	Inhalation, ingestion, skin and/or eye contact	headache, dizziness; nausea, vomiting, malaise (vague feeling of discomfort); myoclonic jerks of limbs; clonic, tonic convulsions; coma; hematuria (blood in the urine), azotemia; [potential occupational carcinogen]	Developmemntal, Endocrine, Liver, Immune System, Nervous System,	Colorless to dark-brown crystalline solid with a mild chemical odor. BP: 293°F Fl.Pt. = 150°F LEL: NA UEL: NA
Lindane (gamma-BHC)	58-89-9	TWA 0.5 mg/m3	TWA 0.5 mg/m3	TWA 0.5 mg/m3	50 mg/m3	Inhalation, ingestion, skin and/or eye contact	irritation eyes, skin, nose, throat; headache; nausea; clonic convulsions; resp difficulty; cyanosis; aplastic anemia; muscle spasm; In Animals: liver, kidney damage	Eyes, skin, respiratory system, central nervous system, blood, liver, kidneys	White to yellow, crystalline powder with a slight, musty odor. BP: 614°F Fl.Pt. = 150°F LEL: NA UEL: NA
Dieldrin	860-57-1	TWA 0.1 mg/m3	TWA 0.25 mg/m3	TWA 0.25 mg/m3	25 mg/m3	Inhalation, ingestion, skin and/or eye contact	headache, dizziness; nausea, vomiting, malaise (vague feeling of discomfort), sweating; myoclonic limb jerks; clonic, tonic convulsions; coma; ; In Animals: liver, kidney damage [potential occupational carcinogen]	Developmemntal, Endocrine, Liver, Immune System, Nervous System,	Colorless to light-tan crystals with a mild, chemical odor. BP: NA (Decomposes) Fl.Pt. = NA LEL: NA UEL: NA
VOLATILE ORGANIC COMPOUNDS (VOCs)									
1,1,1-Trichloroethane	71-55-6	TWA 350 ppm STEL 450 ppm	C 350 ppm (1900 mg/m^3) [15-minute]	TWA 350 ppm (1900 mg/m^3)	700 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin; headache, lassitude (weakness, exhaustion), central nervous system depression, poor equilibrium; dermatitis; cardiac arrhythmias; liver damage	Eyes, skin, central nervous system, cardiovascular system, liver	Colorless liquid with a mild, chloroform-like odor. BP: 165°F Fl.Pt. = NA LEL: 7.5% UEL: 12.5% Combustible Liquid, but burns with difficulty
1,1,2,2-Tetrachloroethane	79-34-5	TWA 1 ppm [skin]	Ca TWA 1 ppm (7 mg/m^3) [skin]	TWA 5 ppm (35 mg/m^3) [skin]	Ca [100 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Nausea, vomiting, abdominal pain; tremor fingers; jaundice, hepatitis, liver tenderness; dermatitis; leukocytosis (increased blood leukocytes); kidney damage; [potential occupational carcinogen]	Skin, liver, kidneys, central nervous system, gastrointestinal tract	Colorless to pale-yellow liquid with a pungent, chloroform-like odor BP: 296°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Liquid
1,1,2-Trichloro-1,2,2-trifluoroethane	76-13-1	TWA 1000 ppm STEL 1250 ppm	TWA 1000 ppm (7600 mg/m3) ST 1250 ppm (9500 mg/m3)	TWA 1000 ppm (7600 mg/m3)	2000 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation skin, throat, drowsiness, dermatitis; central nervous system depression; In Animals: cardiac arrhythmias, narcosis	Skin, heart, central nervous system, cardiovascular system	Colorless to water-white liquid with an odor like carbon tetrachloride at high concentrations. [Note: A gas above 118°F.] BP: 118°F Fl.Pt. = NA LEL: NA UEL: NA
1,1,2-Trichloroethane	79-00-5	TWA 10 ppm [skin]	Ca TWA 10 ppm (45 mg/m3) [skin]	TWA 10 ppm (45 mg/m3) [skin]	Ca [100 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, nose; central nervous system depression; liver, kidney damage; dermatitis; [potential occupational carcinogen]	Eyes, respiratory system, central nervous system, liver, kidneys	Colorless liquid with a sweet, chloroform-like odor BP: 237°F Fl.Pt. = NA LEL: 6% UEL: 15.5% Combustible Liquid, forms dense soot
1,1-Dichloroethane	75-34-3	TWA 100 ppm	TWA 100 ppm (400 mg/m^3)	TWA 100 ppm (400 mg/m^3)	3,000 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation skin; central nervous system depression; liver, kidney, lung damage	Skin, liver, kidneys, lungs, central nervous system	Colorless, oily liquid with a chloroform-like odor. BP: 135°F Fl.Pt. = 2°F LEL: 5.4% UEL: 11.4% Class IB Flammable Liquid Fl.P. below 73°F and BP at or above 100°F.
1,1-Dichloroethene	75-35-4	TWA 5 ppm	Ca	None	Ca	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, throat; dizziness, headache, nausea, dyspnea (breathing difficulty); liver, kidney disturbance; pneumonitis; [potential occupational carcinogen]	Eyes, skin, respiratory system, central nervous system, liver, kidneys	Colorless liquid or gas (above 89°F) with a mild, sweet, chloroform-like odor BP: 89°F Fl.Pt. = -2°F LEL: 6.5% UEL: 15.5% Class IA Flammable Liquid: Fl.P. below 73°F and BP below 100°F

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at 1360 E Main Street, Shrub Oak, New York.

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
1,2,3-Trichlorobenzene	87-61-6	Cameo Chemicals Source https://cameochemicals.noaa.gov/chemical/10051	NA	NA	NA	Inhalation, skin absorption, ingestion, skin and/or eye contact	Inhalation may cause irritation of respiratory tract. Irritating to the eyes. May redden skin on contact. Ingestion may cause liver damage.	Skin, eyes, respiratory tract, liver	A white solid with a sharp chlorobenzene odor. Insoluble in water and denser than water. Hence sinks in water Fl.Pt. = 234.9°F
1,2,4-Trichlorobenzene	120-82-1	C 5 ppm	C 5 ppm (40 mg/m3)	None	N.D.	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation eyes, skin, mucous membrane; In Animals: liver, kidney damage; possible teratogenic effects	Eyes, skin, respiratory system, liver, reproductive system	Colorless liquid or crystalline solid (below 63°F) with an aromatic odor BP: 416°F Fl.Pt. = 222°F LEL (302°F): 2.5% UEL (302°F): 6.6% Class IIIB Combustible Liquid: Fl.P. at or above 200°F. Combustible Solid
1,2-Dibromo-3-chloropropane	96-12-8	NA	Ca	TWA 0.001 ppm	Ca	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; drowsiness; nausea, vomiting; pulmonary edema; liver, kidney injury; sterility; [potential occupational carcinogen]	Eyes, skin, respiratory system, central nervous system, liver, kidneys, spleen, reproductive system, digestive system	Dense yellow or amber liquid with a pungent odor at high concentrations. [pesticide] [Note: A solid below 43°F.] BP: 384°F Fl.Pt. = (oc) 170°F LEL: NA UEL: NA Class IIIA Combustible Liquid: Fl.P. at or above 140°F and below 200°F.
1,2-Dibromoethane	106-93-4	None listed Skin	Ca TWA 0.045 ppm C 0.13 ppm [15-minute]	TWA 20 ppm C 30 ppm 50 ppm [5-minute maximum peak]	Ca [100 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, respiratory system; dermatitis with vesiculation; liver, heart, spleen, kidney damage; reproductive effects; [potential occupational carcinogen]	Eyes, skin, respiratory system, liver, kidneys, reproductive system	Colorless liquid or solid (below 50°F) with a sweet odor. [fumigant] BP: 268°F Fl.Pt. = 50°F LEL: NA UEL: NA Noncombustible Liquid
1,2-Dichlorobenzene	95-50-1	TWA 25 ppm STEL 50 ppm	C 50 ppm (300 mg/m3)	C 50 ppm (300 mg/m3)	200 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, nose; liver, kidney damage; skin blisters	Eyes, skin, respiratory system, liver, kidneys	Colorless to pale-yellow liquid with a pleasant, aromatic odor. [herbicide] BP: 357°F Fl.Pt. = 1°F LEL: 2.2% UEL: 9.2% Class IIIA Combustible Liquid: Fl.P. at or above 140°F and below 200°F.
1,2-Dichloroethane	107-06-2	TWA 10 ppm	Ca TWA 1 ppm (4 mg/m3) ST 2 ppm (8 mg/m3)	TWA 50 ppm C 100 ppm 200 ppm [5-minute maximum peak in any 3 hours]	Ca [50 ppm]	Inhalation, ingestion, skin absorption, skin and/or eye contact	Irritation eyes, corneal opacity; central nervous system depression; nausea, vomiting; dermatitis; liver, kidney, cardiovascular system damage; [potential occupational carcinogen]	Eyes, skin, kidneys, liver, central nervous system, cardiovascular system	Colorless liquid with a pleasant, chloroform-like odor. [Note: Decomposes slowly, becomes acidic & darkens in color.] BP: 182°F Fl.Pt. = 56°F LEL: 6.2% UEL: 16% Class IB Flammable Liquid Fl.P. below 73°F and BP at or above 100°F.
1,2-Dichloropropane	78-87-5	TWA 10 ppm Dermal Sensitizer (DSEN)	Ca	TWA 75 ppm (350 mg/m3)	Ca [400 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, respiratory system; drowsiness, dizziness; liver, kidney damage; In Animals: central nervous system depression; [potential occupational carcinogen]	Eyes, skin, respiratory system, liver, kidneys, central nervous system	Colorless liquid with a chloroform-like odor. [pesticide] BP: 206°F Fl.Pt. = 60°F LEL: 3.4% UEL: 14.5% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F.
1,3-Dichlorobenzene	541-73-1	https://cameochemicals.noaa.gov/chemical/8514				Inhalation, skin absorption, ingestion, skin and/or eye contact	INHALATION: Causes headache, drousiness, unsteadiness. Irritating to mucous membranes. EYES: Severe irritation. SKIN: Severe irritation. INGESTION: Irritation of gastric mucosa, nausea, vomiting, diarrhea, abdominal cramps and cyanosis.		Colorless liquid. Sinks in water. BP: 343°F Fl.Pt. = 146°F LEL: 2.02% UEL: 9.2%
1,4-Dichlorobenzene	106-46-7	TWA 10 ppm	Ca	TWA 75 ppm (450 mg/m3)	Ca [150 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Eye irritation, swelling periorbital (situated around the eye); profuse rhinitis; headache, anorexia, nausea, vomiting; weight loss, jaundice, cirrhosis; In Animals: liver, kidney injury; [potential occupational carcinogen]	Liver, respiratory system, eyes, kidneys, skin	Colorless or white crystalline solid with a mothball-like odor. [insecticide] BP: 345°F Fl.Pt. = 150°F LEL: 2.5% UEL: NA Combustible Solid, but may take some effort to ignite.
1,4-Dioxane	123-91-1	TWA 20 ppm [skin]	Ca C 1 ppm (3.6 mg/m3) [30-minute]	TWA 100 ppm (360 mg/m3) [skin]	Ca [500 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	irritation eyes, skin, nose, throat; drowsiness, headache; nausea, vomiting; liver damage; kidney failure; [potential occupational carcinogen]	Eyes, skin, respiratory system, liver, kidneys	Colorless liquid or solid (below 53°F) with a mild, ether-like odor. BP: 214°F Fl.Pt. = 55°F LEL: 2.0% UEL: 22% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F
2-Butanone	78-93-3	TWA 200 ppm STEL 300 ppm	TWA 200 ppm (590 mg/m3) ST 300 ppm (885 mg/m3)	TWA 200 ppm (590 mg/m3)	3000 ppm	inhalation, ingestion, skin and/or eye contact	irritation eyes, skin, nose; headache; dizziness; vomiting; dermatitis	Eyes, skin, respiratory system, central nervous system	Colorless liquid with a moderately sharp, fragrant, mint- or acetone-like odor BP: 175°F Fl.Pt. = 16°F LEL (200°F): 1.4% UEL (200°F): 11.4% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at 1360 E Main Street, Shrub Oak, New York.

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
2-Hexanone	591-78-6	TWA 5 ppm STEL 10 ppm [skin]	TWA 1 ppm (4 mg/m3)	TWA 100 ppm (410 mg/m3)	1600 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, nose; peripheral neuropathy: lassitude (weakness, exhaustion), paresthesia; dermatitis; headache, drowsiness	Eyes, skin, respiratory system, central nervous system, peripheral nervous system	Colorless liquid with an acetone-like odor BP: 262°F Fl.Pt. = 77°F LEL: NA UEL: 8.0% Class IC Flammable Liquid: Fl.P. at or above 73°F and below 100°F
4-Methyl-2-pentanone	108-10-1	TWA 20 ppm STEL 75 ppm	TWA 50 ppm (205 mg/m3) ST 75 ppm (300 mg/m3)	TWA 100 ppm (410 mg/m3)	500 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, mucous membrane; headache, narcosis, coma; dermatitis; In Animals: liver, kidney damage	Eyes, skin, respiratory system, central nervous system, liver, kidneys	Colorless liquid with a pleasant odor BP: 242°F Fl.Pt. = 64°F LEL (200°F): 1.2% UEL (200°F): 8.0% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F
Acetone	67-64-1	TWA 250 ppm STEL 500 ppm	TWA 250 ppm (590 mg/m^3)	TWA 1000 ppm (2400 mg/m^3)	2500 ppm [10% LEL]	Inhalation, ingestion, skin and/or eye contact	irritation eyes, nose, throat; headache, dizziness, central nervous system depression; dermatitis	Eyes, skin, respiratory system, central nervous system	Colorless liquid with a fragrant, mint-like odor BP: 133°F Fl.Pt. = 0°F LEL: 12.8% UEL: 2.5% Class IB Flammable liquid: Fl.P. below 73°F and BP at or above 100°F.
Benzene	71-43-2	TWA 0.5 ppm STEL 2.5 ppm	Ca TWA 0.1 ppm ST 1 ppm	TWA 1 ppm ST 5 ppm	Ca [500 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, respiratory system; dizziness; headache, nausea, staggered gait; anorexia, lassitude (weakness, exhaustion); dermatitis; bone marrow depression; [potential occupational carcinogen]	Eyes, skin, respiratory system, blood, central nervous system, bone marrow	Colorless to light yellow liquid with an aromatic odor [Note: Solid below 42 °F] BP: 176°F Fl.Pt. = 12°F LEL: 1.2% UEL: 7.8% Class IB Flammable liquid. Fl.P. below 73°F and BP at or above 100°F.
Bromochloromethane	74-97-5	TWA 200 ppm	TWA 200 ppm (1050 mg/m3)	TWA 200 ppm (1050 mg/m3)	2000 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, throat; confusion, dizziness, central nervous system depression; pulmonary edema	Eyes, skin, respiratory system, liver, kidneys, central nervous system	Colorless to pale-yellow liquid with a chloroform-like odor. [Note: May be used as a fire extinguishing agent.] BP: 155°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Liquid
Bromodichloromethane	75-27-4	https://cameochemicals.noaa.gov/chemical/16064				Inhalation, ingestion, skin and/or eye contact	Symptoms of exposure to this compound may include irritation of the skin, eyes, mucous membranes and respiratory tract. It may also cause narcosis. Other symptoms may include nausea, dizziness and headache.	Liver and kidney damage. Central nervous system effects may also occur.	Clear colorless liquid BP: 189°F Fl.Pt. = NA LEL: NA UEL: NA
Bromoform	75-25-2	TWA 0.5 ppm	TWA 0.5 ppm (5 mg/m3) [skin]	TWA 0.5 ppm (5 mg/m3) [skin]	850 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, respiratory system; central nervous system depression; liver, kidney damage	Eyes, skin, respiratory system, central nervous system, liver, kidneys	Colorless to yellow liquid with a chloroform-like odor. [Note: A solid below 47°F.] BP: 301°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Liquid
Bromomethane	74-83-9	TWA 1 ppm [skin]	Ca	C 20 ppm (80 mg/m3) [skin]	Ca [250 ppm]	Inhalation, skin absorption (liquid), skin and/or eye contact (liquid)	Irritation eyes, skin, respiratory system; muscle weak, incoordination, visual disturbance, dizziness; nausea, vomiting, headache; malaise (vague feeling of discomfort); hand tremor; convulsions; dyspnea (breathing difficulty); skin vesiculation; liquid: frostbite; [potential occupational carcinogen]	Eyes, skin, respiratory system, central nervous system	Colorless gas with a chloroform-like odor at high concentrations. [Note: A liquid below 38°F. Shipped as a liquefied compressed gas.] BP: 38°F Fl.Pt. = NA (Gas) LEL: 10% UEL: 16.0% Flammable Gas, but only in presence of a high energy ignition source.
Carbon disulfide	75-15-0	TWA 1 ppm [skin]	TWA 1 ppm (3 mg/m3) ST 10 ppm (30 mg/m3) [skin]	TWA 20 ppm C 30 ppm 100 ppm (30-minute maximum peak)	500 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Dizziness, headache, poor sleep, lassitude (weakness, exhaustion), anxiety, anorexia, weight loss; psychosis; polyneuropathy; Parkinson-like syndrome; ocular changes; coronary heart disease; gastritis; kidney, liver injury; eye, skin burns; dermatitis; reproductive effects	Central nervous system, peripheral nervous system, cardiovascular system, eyes, kidneys, liver, skin, reproductive system	Colorless to faint-yellow liquid with a sweet ether-like odor. [Note: Reagent grades are foul smelling.] BP: 116°F Fl.Pt. = -22°F LEL: 1.3% UEL: 50.0% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F.
Carbon tetrachloride	56-23-5	TWA 5 ppm STEL 10 ppm [skin]	Ca ST 2 ppm (12.6 mg/m3) [60-minute]	TWA 10 ppm C 25 ppm 200 ppm (5-minute maximum peak in any 4 hours)	Ca [200 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin; central nervous system depression; nausea, vomiting; liver, kidney injury; drowsiness, dizziness, incoordination; [potential occupational carcinogen]	Central nervous system, eyes, lungs, liver, kidneys, skin	Colorless liquid with a characteristic ether-like odor BP: 170°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Liquid
Chlorobenzene	108-90-7	TWA 10 ppm	NA	TWA 75 ppm (350 mg/m3)	1000 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, nose; drowsiness, incoordination; central nervous system depression; In Animals: liver, lung, kidney injury	Eyes, skin, respiratory system, central nervous system, liver	Colorless liquid with an almond-like odor BP: 270°F Fl.Pt. = 82°F LEL: 1.3% UEL: 9.6% Class IC Flammable Liquid: Fl.P. at or above 73°F and below 100°F.

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at 1360 E Main Street, Shrub Oak, New York.

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
Chloroethane	75-00-3	TWA 100 ppm [skin]	Handle with caution in the workplace	TWA 1000 ppm (2600 mg/m3)	3800 ppm [10%LEL]	Inhalation, skin absorption (liquid), ingestion (liquid), skin and/or eye contact	Incoordination, inebriation; abdominal cramps; cardiac arrhythmias, cardiac arrest; liver, kidney damage	Liver, kidneys, respiratory system, cardiovascular system, central nervous system	Colorless gas or liquid (below 54°F) with a pungent, ether-like odor. [Note: Shipped as a liquefied compressed gas.] BP: 54°F Fl.Pt. = NA (gas), -58°F (liquid) LEL: 3.8% UEL: 15.4% Flammable Gas
Chloroform	67-66-3	TWA 10 ppm	Ca ST 2 ppm (9.78 mg/m3) [60-minute]	C 50 ppm (240 mg/m3)	Ca [500 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin; dizziness, mental dullness, nausea, confusion; headache, lassitude (weakness, exhaustion); anesthesia; enlarged liver; [potential occupational carcinogen]	Liver, kidneys, heart, eyes, skin, central nervous system	Colorless liquid with a pleasant odor BP: 143°F Fl.Pt. = -82°F LEL: NA UEL: NA Noncombustible Liquid
Chloromethane	74-87-3	TWA 50 ppm STEL 100 ppm	Ca	TWA 100 ppm C 200 ppm 300 ppm (5-minute maximum peak in any 3 hours)	Ca [2000 ppm]	Inhalation, skin and/or eye contact (liquid)	Dizziness, nausea, vomiting; visual disturbance, stagger, slurred speech, convulsions, coma; liver, kidney damage; liquid: frostbite; reproductive, teratogenic effects; [potential occupational carcinogen]	Central nervous system, liver, kidneys, reproductive system	Colorless gas with a faint, sweet odor which is not noticeable at dangerous concentrations. [Note: Shipped as a liquefied compressed gas.] BP: -12°F Fl.Pt. = NA (Gas) LEL: 8.1% UEL: 17.4% Flammable Gas
cis-1,2-Dichloroethene	156-59-2	TWA 200 ppm (All isomers)	TWA 200 ppm (790 mg/m3)	TWA 200 ppm (790 mg/m3)	1000 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, respiratory system; central nervous system depression	Eyes, respiratory system, central nervous system	Colorless liquid (usually a mixture of the cis & trans isomers) with a slightly acrid, chloroform-like odor. BP: 118-140°F Fl.Pt. = 36-39°F LEL: 5.6% UEL: 12.8% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F
cis-1,3-Dichloropropene	10061-01-5	https://cameochemicals.noaa.gov/chemical/20168				Inhalation, ingestion, skin and/or eye contact	Symptoms of exposure to this compound may include local irritation of the eyes skin and respiratory tract; dermatitis, gasping, coughing, substernal pain, extreme respiratory distress, lacrimation, central nervous system depression, skin irritation, acute gastrointestinal distress with pulmonary congestion and edema. It also may cause injury to the liver, kidneys and heart.	Skin, eyes, mucous membranes, liver, kidney, heart	Colorless to amber liquid with a sweetish odor. BP: 219.7°F Fl.Pt. = NA LEL: NA UEL: NA
Cyclohexane	110-82-7	TWA 100 ppm	TWA 300 ppm (1050 mg/m3)	TWA 300 ppm (1050 mg/m3)	1300 ppm [10%LEL]	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, respiratory system; drowsiness; dermatitis; narcosis, coma	Eyes, skin, respiratory system, central nervous system	Colorless liquid with a sweet, chloroform-like odor. [Note: A solid below 44°F.] BP: 177°F Fl.Pt. = 0°F LEL: 1.3% UEL: 8.0% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F.
Dibromochloromethane	124-48-1	https://cameochemicals.noaa.gov/chemical/16183				Inhalation, ingestion, skin and/or eye contact	Symptoms of exposure to this compound may include irritation of the skin, eyes, mucous membranes and upper respiratory tract. It may also cause fatigue. Other symptoms may include central nervous system effects, lung and cornea irritation and liver and kidney damage. Prolonged exposure can cause nausea, dizziness, headache and narcosis.	Skin, eyes, mucous membranes, upper respiratory tract	Clear colorless to yellow-orange liquid BP: 246-248°F Fl.Pt. = Greater than 200°F LEL: NA UEL: NA
Dichlorodifluoromethane	75-71-8	TWA 1000 ppm	TWA 1000 ppm (4950 mg/m3)	TWA 1000 ppm (4950 mg/m3)	15,000 ppm	Inhalation, skin and/or eye contact (liquid)	Dizziness, tremor, asphyxia, unconsciousness, cardiac arrhythmias, cardiac arrest; liquid: frostbite	Cardiovascular system, peripheral nervous system	Colorless gas with an ether-like odor at extremely high concentrations. [Note: Shipped as a liquefied compressed gas.] BP: -22°F Fl.Pt. = NA LEL: NA UEL: NA Nonflammable Gas
Ethyl benzene	100-41-4	TWA 20 ppm	TWA 100 ppm (435 mg/m^3) ST 125 ppm (545 mg/m^3)	TWA 100 ppm (435 mg/m^3)	800 ppm [10%LEL]	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, mucous membrane; headache; dermatitis; narcosis, coma	Eyes, skin, respiratory system, central nervous system	Colorless liquid with an aromatic odor. BP: 277°F Fl.Pt. = 55°F LEL: 0.8% UEL: 6.7% Class IB Flammable Liquid below 73°F and BP at or above 100°F
Isopropyl benzene	98-82-8	TWA 5 ppm	TWA 50 ppm (245 mg/m3) [skin]	TWA 50 ppm (245 mg/m3) [skin]	900 ppm [10%LEL]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, mucous membrane; dermatitis; headache, narcosis, coma	Eyes, skin, respiratory system, central nervous system	Colorless liquid with a sharp, penetrating, aromatic odor BP: 306°F Fl.Pt. = 96°F LEL: 0.9% UEL: 6.5% Class IC Flammable Liquid: Fl.P. at or above 73°F and below 100°F
Methyl Acetate	79-20-9	TWA 200 ppm STEL 250 ppm	TWA 200 ppm (610 mg/m3) ST 250 ppm (760 mg/m3)	TWA 200 ppm (610 mg/m3)	3100 ppm [10%LEL]	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; headache, drowsiness; optic nerve atrophy; chest tightness; In Animals: narcosis	Eyes, skin, respiratory system, central nervous system	Colorless liquid with a fragrant, fruity odor BP: 135°F Fl.Pt. = 14°F LEL: 3.1% UEL: 16% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F.

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at 1360 E Main Street, Shrub Oak, New York.

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
Methylcyclohexane	108-87-2	TWA 400 ppm	TWA 400 ppm (1600 mg/m3)	TWA 500 ppm (2000 mg/m3)	1200 ppm [LEL]	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; dizziness, drowsiness; In Animals: narcosis	Eyes, skin, respiratory system, central nervous system	Colorless liquid with a faint, benzene-like odor BP: 214°F Fl.Pt. = 25°F LEL: 1.2% UEL: 6.7% Class IB Flammable Liquid: Fl.P. below 73°F and BP at or above 100°F.
Methylene chloride	75-09-2	TWA 50 ppm [skin] STEL 100 ppm	Ca	[1910.1052] TWA 25 ppm ST 125 ppm	Ca [2300 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin; lassitude (weakness, exhaustion), drowsiness, dizziness; numb, tingle limbs; nausea; [potential occupational carcinogen]	Eyes, skin, cardiovascular system, central nervous system	Colorless liquid with a chloroform-like odor. [Note: A gas above 104°F.] BP: 104°F Fl.Pt. = NA LEL: 13% UEL: 23% Combustible Liquid
Methyl-t-butyl ether	1634-04-4	TWA 50 ppm	NA	NA	NA	Inhalation, skin absorption, ingestion, skin and/or eye contact	May cause dizziness or suffocation. Contact may irritate or burn eyes or skin. May be harmful if swallowed.	Eyes, skin	A colorless liquid with a distinctive anesthetic-like odor. BP: 131°F Fl.Pt. = -14°F LEL: NA UEL: NA
o-Xylene	95-47-6	TWA 20 ppm (All isomers)	TWA 100 ppm (435 mg/m3) ST 150 ppm (655 mg/m3)	TWA 100 ppm (435 mg/m3)	900 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; dizziness, excitement, drowsiness, incoordination, staggering gait; corneal vacuolization; anorexia, nausea, vomiting, abdominal pain; dermatitis	Eyes, skin, respiratory system, central nervous system, gastrointestinal tract, blood, liver, kidneys	Colorless liquid with an aromatic odor BP: 292°F Fl.Pt. = 90°F LEL: 0.9% UEL: 6.7% Class IC Flammable Liquid: Fl.P. at or above 73°F and below 100°F
Styrene	100-42-5	TWA 10 ppm STEL 20 ppm OTO (ototoxicant)	TWA 50 ppm (215 mg/m3) ST 100 ppm (425 mg/m3)	TWA 100 ppm C 200 ppm 600 ppm (5-minute maximum peak in any 3 hours)	700 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, nose, respiratory system; headache, lassitude (weakness, exhaustion), dizziness, confusion, malaise (vague feeling of discomfort), drowsiness, unsteady gait; narcosis; defatting dermatitis; possible liver injury; reproductive effects	Eyes, skin, respiratory system, central nervous system, liver, reproductive system	Colorless to yellow, oily liquid with a sweet, floral odor BP: 293°F Fl.Pt. = 88°F LEL: 0.9% UEL: 6.8% Class IC Flammable Liquid: Fl.P. at or above 73°F and below 100°F
Tetrachloroethene	127-18-4	TWA 25 ppm STEL 100 ppm	Ca Minimize workplace exposure concentrations	TWA 100 ppm C 200 ppm (for 5 minutes in any 3-hour period), with a maximum peak of 300 ppm	Ca [150 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat, respiratory system; nausea; flush face, neck; dizziness, incoordination; headache, drowsiness; skin erythema (skin redness); liver damage; [potential occupational carcinogen]	Eyes, skin, respiratory system, liver, kidneys, central nervous system	Colorless liquid with a mild, chloroform-like odor BP: 250°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Liquid, but decomposes in a fire to hydrogen chloride and phosgene
Sodium Hydroxide	1310-73-2	Ceiling 2 mg/m^3	C 2 mg/m^3	TWA 2 mg/m^3	10 mg/m^3	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, mucous membrane; pneumonitis; eye, skin burns; temporary loss of hair	Eyes, skin, respiratory system	Colorless to white, odorless solid (flakes, beads, granular form). BP: 2534°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solid, but when in contact with water may generate sufficient heat to ignite combustible materials.
Sulfuric Acid	7664-93-9	TWA 0.2 mg/m^3 (as thoracic particulate mass)	TWA 1 mg/m^3	TWA 1 mg/m^3	15 mg/m^3	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; pulmonary edema, bronchitis; emphysema; conjunctivitis; stomatis; dental erosion; eye, skin burns; dermatitis	Eyes, skin, respiratory system, teeth	Colorless to dark-brown, oily, odorless liquid.[Note: Pure compound is a solid below 51°F. Often used in an aqueous solution.] BP = 554°F Fl.Pt. = NA LEL = NA UEL = NA Noncombustible Liquid, but capable of igniting finely divided combustible materials.
trans-1,2-Dichloroethene	156-60-5	200 ppm (All isomers)	TWA 200 ppm (790 mg/m3)	TWA 200 ppm (790 mg/m3)	1000 ppm	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, respiratory system; central nervous system depression	Eyes, respiratory system, central nervous system	Colorless liquid (usually a mixture of the cis & trans isomers) with a slightly acrid, chloroform-like odor. BP: 118-140°F Fl.P: 36-39°F LEL: 5.6% UEL: 12.8% Class IB Flammable Liquid Fl.P. below 73°F and BP at or above 100°F.
trans-1,3-Dichloropropene	10061-02-6	https://cameochemicals.noaa.gov/chemical/18110				Inhalation, ingestion, skin and/or eye contact	Symptoms of exposure to this compound may include local irritation of the eyes skin and respiratory tract, dermatitis, gasping, coughing, substernal pain, extreme respiratory distress, lacrimation, central nervous system depression, acute gastrointestinal distress with pulmonary congestion and edema. It may also cause injury to the liver, kidneys and heart	Skin, eyes, mucous membranes, liver, kidney, heart	A clear colorless liquid with chloroform odor BP: 234°F Fl.P: NA LEL: NA UEL: NA

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at 1360 E Main Street, Shrub Oak, New York.

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
Toluene	108-88-3	TWA 20 ppm (ototoxicant)	TWA 100 ppm (375 mg/m^3) ST 150 ppm (560 mg/m^3)	TWA 200 ppm C 300 ppm 500 ppm (10-minute maximum peak)	500 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	irritation eyes, nose; lassitude (weakness, exhaustion), confusion, euphoria, dizziness, headache; dilated pupils, lacrimation (discharge of tears); anxiety, muscle fatigue, insomnia; paresthesia; dermatitis; liver, kidney damage	Eyes, skin, respiratory system, central nervous system, liver, kidneys	Colorless liquid with a sweet, pungent, benzene-like odor. BP: 232°F Fl.P: 40°F LEL: 1.1% UEL: 7.1% Class IB Flammable Liquid Fl.P. below 73°F and BP at or above 100°F.
Trichloroethene (TCE)	79-01-6	TWA 10 ppm STEL 25 ppm	Ca	TWA 100 ppm C 200 ppm 300 ppm (5-minute maximum peak in any 2 hours)	Ca [1000 ppm]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin; headache, visual disturbance, lassitude (weakness, exhaustion), dizziness, tremor, drowsiness, nausea, vomiting; dermatitis; cardiac arrhythmias, paresthesia; liver injury; [potential occupational carcinogen]	Eyes, skin, respiratory system, heart, liver, kidneys, central nervous system	Colorless liquid (unless dyed blue) with a chloroform-like odor. BP: 189°F Fl.Pt. = NA LEL(77°F): 8.0% UEL(77°F): 10.5% Combustible Liquid, but burns with difficulty.
Trichlorofluoromethane	75-69-4	STEL C 1000 ppm	C 1000 ppm (5600 mg/m3)	TWA 1000 ppm (5600 mg/m3)	2000 ppm	Inhalation, ingestion, skin and/or eye contact	Incoordination, tremor; dermatitis; cardiac arrhythmias, cardiac arrest; asphyxia; liquid: frostbite	Skin, respiratory system, cardiovascular system	Colorless to water-white, nearly odorless liquid or gas (above 75°F) BP: 75°F Fl.P: NA LEL: NA UEL: NA Noncombustible Liquid Nonflammable Gas
Vinyl Chloride (chloroethylene)	75-01-4	TWA 1 ppm	Ca	TWA 1 ppm C 5 ppm [15-minute]	Ca (ND)	Inhalation, skin and/or eye contact (liquid)	Lassitude (weakness, exhaustion); abdominal pain, gastrointestinal bleeding; enlarged liver; pallor or cyanosis of extremities; liquid: frostbite; [potential occupational carcinogen]	Liver, central nervous system, blood, respiratory system, lymphatic system	Colorless gas or liquid (below 7°F) with a pleasant odor at high concentrations.[Note: Shipped as a liquefied compressed gas.] BP: 7°F Fl.Pt. = NA (Gas) LEL: 3.6% UEL: 33.0% Flammable Gas
Xylene (m, o & p isomers)	108-38-3, 95-47-6, 106-42-3	TWA 20 ppm	NA	NA	NA	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; dizziness, excitement, drowsiness, incoordination, staggering gait; corneal vacuolization; anorexia, nausea, vomiting, abdominal pain; dermatitis	Eyes, skin, respiratory system, central nervous system, gastrointestinal tract, blood, liver, kidneys	Colorless liquid with an aromatic odor BP: 282°F, 292°F, 281°F Fl. Pt. 82°F, 90°F, 81°F LEL: 1.1%, 0.9%, 1.1% UEL: 7.0%, 6.7%, 7.0% Class IC Flammable Liquid at or above 73°F and below 100°F.
Zinc Oxide (dust)	7440-66-6	TWA 2 mg/m3 (repsirable) STEL 10 mg/m^3 (respirable)	TWA 5 mg/m^3 C 15 mg/m^3	TWA 15 mg/m^3 (total dust) TWA 5 mg/m^3 (resp dust) TWA 5 mg/m^3 (fume)	500 mg/m^3	Inhalation	Metal fume fever: chills, muscle ache, nausea, fever, dry throat, cough; lassitude (weakness, exhaustion); metallic taste; headache; blurred vision; low back pain; vomiting; malaise (vague feeling of discomfort); chest tightness; dyspnea (breathing difficulty), rales, decreased pulmonary function	Respiratory system	White, odorless solid. BP: NA Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solid
SEMI-VOLATILE ORGANIC COMPOUNDS (SVOCs)									
2-Chloronaphthalene	91-58-7	https://cameochemicals.noaa.gov/chemical/16185				Inhalation, ingestion, skin and/or eye contact	Chloracne, cysts, headache, fatigue, vertigo, anorexia and jaundice		Monoclinic plates or off-white crystalline powder BP: NA Fl.Pt. = NA LEL: NA UEL: NA
2-Methylnaphthalene	91-57-6	TWA 0.5 ppm TLV-SL 3 mg/100 cm2 [skin]	https://cameochemicals.noaa.gov/chemical/20668			Inhalation, ingestion, skin and/or eye contact	Headaches, nausea, vomiting, diarrhea, anemia, jaundice, euphoria, dermatitis, visual disturbances, convulsions and comatose	Skin, eyes, mucous membranes and upper respiratory tract	White crystalline solid Combustible solid BP: 466-468 ° F Fl.Pt. = 208 ° F LEL: NA UEL: NA
Acenaphthene	83-32-9	https://cameochemicals.noaa.gov/chemical/10358				Inhalation, ingestion, skin and/or eye contact	Irritation of the skin, eyes, mucous membranes and upper respiratory tract, vomiting	Skin, eyes, mucous membranes and upper respiratory tract	White needles BP: 534 ° F Fl.Pt. = NA LEL: 0.6% UEL: NA
Acenaphthylene	208-96-8	https://cameochemicals.noaa.gov/chemical/16157				Inhalation, ingestion, skin and/or eye contact			Colorless crystalline solid BP: 509 to 527 ° F at 760 mm Hg Fl.Pt. = NA LEL: NA UEL: NA
Anthracene (as coal tar pitch volatiles)	120-12-7	TWA 0.2 mg/m3 (as Benzene solubles)	Ca TWA 0.1 mg/m3 (cyclohexane-extractable fraction)	TWA 0.2 mg/m3 (benzene-soluble fraction) [1910.1002]	Ca [80 mg/m3]	Inhalation, skin and/or eye contact	Dermatitis, bronchitis, [potential occupational carcinogen]	Respiratory system, skin, bladder, kidneys	Black or dark-brown amorphous residue BP: NA Fl.Pt. = NA LEL: NA UEL: NA Combustible Solids
Benzo[a]anthracene	56-55-3	https://cameochemicals.noaa.gov/chemical/16171				Inhalation, injestion, skin and/or eye contact			Colorless leaflets or plates or coarse gold powder with a greenish-yellow fluorescence. May reasonably be expected to be a carcinogen. BP: 815° F at 760 mm Hg Fl.Pt. = NA LEL: NA UEL: NA

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at 1360 E Main Street, Shrub Oak, New York.

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
Benzo[a]pyrene (as coal tar pitch volatiles)	50-32-8	TWA 0.2 mg/m3 (as Benzene solubles)	Ca TWA 0.1 mg/m3 (cyclohexane-extractable fraction)	TWA 0.2 mg/m3 (benzene-soluble fraction) [1910.1002]	Ca [80 mg/m3]	Inhalation, skin and/or eye contact	Dermatitis, bronchitis, [potential occupational carcinogen]	Respiratory system, skin, bladder, kidneys	Black or dark-brown amorphous residue BP: NA Fl.Pt. = NA LEL: NA UEL: NA Combustible Solids
Benzo[b]fluoranthene	205-99-2	None listed	https://cameochemicals.noaa.gov/chemical/16172			Inhalation, injestion, skin and/or eye contact			Needles or yellow fluffy powder BP: NA Fl.Pt. = NA LEL: NA UEL: NA
Benzo[g,h,i]perylene	191-24-2	https://cameochemicals.noaa.gov/chemical/16174				Inhalation, injestion, skin and/or eye contact	Inhalation of material may be harmful. Contact may cause burns to skin and eyes. Inhalation of Asbestos dust may have a damaging effect on the lungs. Fire may produce irritating, corrosive and/or toxic gases. Some liquids produce vapors that may cause dizziness or suffocation. Runoff from fire control may cause pollution.	Lungs, skin, eyes	Colorless to white crystalline solid. Water insoluble. BP: NA Fl.Pt. = NA LEL: NA UEL: NA
Benzo[k]fluoranthene	207-08-9	https://cameochemicals.noaa.gov/chemical/16173				Inhalation, injestion, skin and/or eye contact	When heated to decomposition this compound emits acrid smoke and irritating fumes.		Pale yellow needles or yellow crystalline solid BP: 896° F Fl.Pt. = NA LEL: NA UEL: NA
Chrysene (as coal tar pitch volatiles	218-01-9	TWA 0.2 mg/m3 (as Benzene solubles)	Ca TWA 0.1 mg/m3 (cyclohexane-extractable fraction)	TWA 0.2 mg/m3 (benzene-soluble fraction) [1910.1002]	Ca [80 mg/m3]	Inhalation, skin and/or eye contact	Dermatitis, bronchitis, [potential occupational carcinogen]	Respiratory system, skin, bladder, kidneys	Black or dark-brown amorphous residue BP: NA Fl.Pt. = NA LEL: NA UEL: NA Combustible Solids
Dibenzo(a,h)anthracene	53-70-3	https://cameochemicals.noaa.gov/chemical/16192				Inhalation, injestion, skin and/or eye contact	Symptoms of exposure to this compound may include irritation. This compound is harmful if swallowed or inhaled. It may cause irritation. When heated to decomposition it emits acrid smoke, irritating fumes and toxic fumes of carbon monoxide and carbon dioxide.	Lungs	White crystals or pale yellow solid. Sublimes BP: 975° F Fl.Pt. = NA LEL: NA UEL: NA
Fluoranthene	206-44-0	https://cameochemicals.noaa.gov/chemical/16213				Inhalation, injestion, skin and/or eye contact	When heated to decomposition this compound emits acrid smoke and fumes.		Light yellow fine crystals BP: 482° F Fl.Pt. = NA LEL: NA UEL: NA
Fluorene	86-73-7	https://cameochemicals.noaa.gov/chemical/16214				Inhalation, injestion, skin and/or eye contact			White leaflets. Sublimes easily under a vacuum. Fluorescent when impure. BP: 563° F Fl.Pt. = NA LEL: NA UEL: NA
Indeno[1,2,3-cd]pyrene	193-39-5	https://cameochemicals.noaa.gov/chemical/16218				Inhalation, injestion, skin and/or eye contact			Yellow crystals BP: 997° F Fl.Pt. = NA LEL: NA UEL: NA
Naphthalene	91-20-3	TWA 10 ppm [skin]	TWA 10 ppm (50 mg/m3) ST 15 ppm (75 mg/m3)	TWA 10 ppm (50 mg/m3)	250 ppm	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes; headache, confusion, excitement, malaise (vague feeling of discomfort); nausea, vomiting, abdominal pain; irritation bladder; profuse sweating; jaundice; hematuria (blood in the urine), renal shutdown; dermatitis, optical neuritis, corneal damage	Eyes, skin, blood, liver, kidneys, central nervous system	Colorless to brown solid with an odor of mothballs. [Note: Shipped as a molten solid.] BP: 424°F Fl.P: 174°F LEL: 0.9% UEL: 5.9% Combustible Solid, but will take some effort to ignite
Phenanthrene	85-01-8	https://cameochemicals.noaa.gov/chemical/16236				Inhalation, injestion, skin and/or eye contact	Symptoms following exposure to this compound may include skin sensitization, dermatitis, bronchitis, cough, dyspnea, respiratory neoplasm, kidney neoplasm, skin irritation, and respiratory irritation.	Skin, respiratory tract	Colorless monoclinic crystals with a faint aromatic odor. Solutions exhibit a blue fluorescence. BP: 642° F Fl.Pt. = 340° F LEL: NA UEL: NA
Pyrene (see coal tar pitch volatiles)	129-00-0	TWA 0.2 mg/m3 (as Benzene solubles)	Ca TWA 0.1 mg/m3 (cyclohexane-extractable fraction)	TWA 0.2 mg/m3 (benzene-soluble fraction) [1910.1002]	Ca [80 mg/m3]	Inhalation, skin and/or eye contact	Dermatitis, bronchitis, [potential occupational carcinogen]	Respiratory system, skin, bladder, kidneys	Black or dark-brown amorphous residue BP: NA Fl.Pt. = NA LEL: NA UEL: NA Combustible Solids
METALS									
Aluminum	7429-90-5	TWA 1 mg/m3	TWA 10 mg/m^3 (total) TWA 5 mg/m^3 (resp)	TWA 15 mg/m^3 (total) TWA 5 mg/m^3 (resp)	N.D.	Inhalation, skin and/or eye contact	Irritation eyes, skin, respiratory system	Eyes, skin, respiratory system	Silvery-white, malleable, ductile, odorless metal BP: 4221°F Fl.Pt. = NA LEL: NA UEL: NA Combustible Solid, finely divided dust is easily ignited; may cause explosions.

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at 1360 E Main Street, Shrub Oak, New York.

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
Antimony	7440-36-0	TWA 0.5 mg/m3 (as Sb)	TWA 0.5 mg/m3 [*Note: The REL also applies to other antimony compounds (as Sb).]	TWA 0.5 mg/m3 [*Note: The PEL also applies to other antimony compounds (as Sb).]	50 mg/m3 (as Sb)	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat, mouth; cough; dizziness; headache; nausea, vomiting, diarrhea; stomach cramps; insomnia; anorexia; unable to smell properly	Eyes, skin, respiratory system, cardiovascular system	Silver-white, lustrous, hard, brittle solid; scale-like crystals; or a dark-gray, lustrous powder BP: 2975°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solid in bulk form, but a moderate explosion hazard in the form of dust when exposed to flame.
Arsenic	7440-38-2	TWA 0.01 mg/m3	Ca C 0.002 mg/m3 [15-minute]	[1910.1018] TWA 0.010 mg/m3	Ca [5 mg/m3 (as As)]	Inhalation, skin absorption, skin and/or eye contact, ingestion	Ulceration of nasal septum, dermatitis, gastrointestinal disturbances, peripheral neuropathy, resp irritation, hyperpigmentation of skin, [potential occupational carcinogen]	Liver, kidneys, skin, lungs, lymphatic system	Metal: Silver-gray or tin-white, brittle, odorless solid BP: Sublimes Fl.Pt. = NA LEL: NA UEL: NA Metal: Noncombustible Solid in bulk form, but a slight explosion hazard in the form of dust when exposed to flame
Barium	7440-39-3	TWA 0.5 mg/m3	0.5 mg Ba/m3 TWA	0.5 mg Ba/m3 TWA	50 mg Ba/m3	Inhalation, ingestion, skin and/or eye contact	Inhalation or contact with vapors, substance or decomposition products may cause severe injury or death. Contact may cause burns to skin, eyes, and mucous membranes. May be toxic by ingestion, inhalation and skin absorption. Used to make other chemicals.	Lungs, skin, eyes, and mucous membrane	A silver to white metallic solid BP: 1337°F Fl.Pt. = NA LEL: NA UEL: NA
Beryllium	7440-41-7	TWA 0.00005 mg/m^3	Ca C 0.0005 mg/m^3	TWA 0.002 mg/m^3 C 0.005 mg/m^3 0.025 mg/m3 [30-minute maximum peak]	Ca [4 mg/m^3 (as Be)]	Inhalation, skin and/or eye contact	Berylliosis (chronic exposure): anorexia, weight loss, lassitude (weakness, exhaustion), chest pain, cough, clubbing of fingers, cyanosis, pulmonary insufficiency; irritation eyes; dermatitis; [potential occupational carcinogen]	Eyes, skin, respiratory system	Hard, brittle, gray-white solid BP: 4532°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solid in bulk form, but a slight explosion hazard in the form of a powder or dust.
Cadmium	7440-43-9	TWA 0.01 mg/m^3 total dust TWA 0.002 mg/m^3 (as Cd) respirable fraction	Ca	TWA 0.005 mg/m^3	Ca [9 mg/m3 (as Cd)]	Inhalation, ingestion	Pulmonary edema, dyspnea (breathing difficulty), cough, chest tightness, substernal (occurring beneath the sternum) pain; headache; chills, muscle aches; nausea, vomiting, diarrhea; anosmia (loss of the sense of smell), emphysema, proteinuria, mild anemia; [potential occupational carcinogen]	Respiratory system, kidneys, prostate, blood	Silver-white/blue tinged lustrous, odorless solid. BP: 1409°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible - will burn in powder form
Calcium	7440-70-2	https://cameochemicals.noaa.gov/chemical/309				Inhalation, ingestion, skin and/or eye contact	Contact with eyes or skin produces caustic burns.	Eyes, skin	A silvery, soft metal that turns grayish white on exposure to air. BP: 2714°F Fl.Pt. = NA LEL: NA UEL: NA
Chromium	7440-47-3	TWA 0.5 mg/m^3 (metal) TWA 0.003 mg/m^3 (water-soluble Cr III compounds) TWA 0.0002 mg/m^3 (water-soluble Cr VI compounds) STEL 0.0005 mg/m3 (water-soluble Cr VI compounds)	TWA 0.5 mg/m^3	TWA 1 mg/m^3	250 mg/m^3 (as Cr)	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin; lung fibrosis (histologic)	Eyes, skin, respiratory system	Blue-white to steel-gray, lustrous, brittle, hard, odorless solid. BP: 4788°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible - will burn in dust form if heated in a flame
Cobalt	7440-48-4	TWA 0.02 mg/m3 [DSEN] [RSEN]	TWA 0.05 mg/m3	TWA 0.1 mg/m3	20 mg/m3 (as Co)	Inhalation, ingestion, skin and/or eye contact	Cough, dyspnea (breathing difficulty), wheezing, decreased pulmonary function; weight loss; dermatitis; diffuse nodular fibrosis; resp hypersensitivity, asthma	Skin, respiratory system	Odorless, silver-gray to black solid BP: 5612°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solid in bulk form, but finely divided dust will burn at high temperatures.
Copper	7440-50-8	TWA 0.2 mg/m^3 (fume) TWA 1 mg/m3 (dusts and mists)	TWA 1 mg/m^3	TWA 1 mg/m^3	100 mg/m^3 (as Cu)	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, nose, pharynx; nasal septum perforation; metallic taste; dermatitis; In Animals: lung, liver, kidney damage; anemia	Eyes, skin, respiratory system, liver, kidneys (increased risk with Wilson's disease)	Reddish, lustrous, malleable, odorless solid. BP: 4703°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible - powdered form may ignite
Iron (as iron oxide)	7439-89-6	TWA 5 mg/m3 (respirable particulate mass)	TWA 1 mg/m^3	NA	NA	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, mucous membrane; abdominal pain, diarrhea, vomiting; possible liver damage	Eyes, skin, respiratory system, liver, gastrointestinal tract	Appearance and odor vary depending upon the specific soluble iron salt. BP: NA Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solids
Lead	7439-92-1	TWA 0.05 mg/m3	TWA (8-hour) 0.050 mg/m3	[1910.1025] TWA 0.050 mg/m3	100 mg/m3 (as Pb)	Inhalation, ingestion, skin and/or eye contact	Lassitude (weakness, exhaustion), insomnia; facial pallor; anorexia, weight loss, malnutrition; constipation, abdominal pain, colic; anemia; gingival lead line; tremor; paralysis wrist, ankles; encephalopathy; kidney disease; irritation eyes; hypertension	Eyes, gastrointestinal tract, central nervous system, kidneys, blood, gingival tissue	A heavy, ductile, soft, gray solid BP: 3164°F Fl.Pt. = NA LEL: NA UEL: NA Noncombustible Solid in bulk form

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at 1360 E Main Street, Shrub Oak, New York.

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
Magnesium	7439-95-4	https://cameochemicals.noaa.gov/chemical/6949				Eye and/or skin contact	Dust irritates eyes in same way as any foreign material. Penetration of skin by fragments of metal is likely to produce local irritation, blisters, and ulcers which may become infected.	Eyes	A light silvery metal BP: 1202°F Fl.Pt. = NA LEL: NA UEL: NA
Manganese	7439-96-5	TWA 0.02 mg/m3 [R] TWA 0.1 mg/m3 [I]	TWA 1 mg/m3 ST 3 mg/m3	C 5 mg/m3	500 mg/m3 (as Mn)	inhalation, ingestion	Manganism; asthenia, insomnia, mental confusion; metal fume fever: dry throat, cough, chest tightness, dyspnea (breathing difficulty), rales, flu-like fever; low-back pain; vomiting; malaise (vague feeling of discomfort); lassitude (weakness, exhaustion); kidney damage	respiratory system, central nervous system, blood, kidneys	A lustrous, brittle, silvery solid BP: 3564°F Fl.Pt. = NA LEL: NA UEL: NA Metal: Combustible Solid
Mercury	7439-97-6	TWA 0.1 mg/m3, as Hg Aryl compounds TWA 0.025 mg/m3 as Hg, inorganic forms including metallic mercury	Hg Vapor: TWA 0.05 mg/m3 [skin] Other: C 0.1 mg/m3 [skin]	TWA 0.1 mg/m3	10 mg/m3 (as Hg)	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin; cough, chest pain, dyspnea (breathing difficulty), bronchitis, pneumonitis; tremor, insomnia, irritability, indecision, headache, lassitude (weakness, exhaustion); stomatitis, salivation; gastrointestinal disturbance, anorexia, weight loss; proteinuria	Eyes, skin, respiratory system, central nervous system, kidneys	Metal: Silver-white, heavy, odorless liquid. [Note: "Other" Hg compounds include all inorganic & aryl Hg compounds except (organo) alkyls.] BP: 674°F Fl.Pt. = NA LEL: NA UEL: NA Metal: Noncombustible Liquid
Nickel	7440-02-0	TWA 1.5 mg/m^3 [elemental] TWA 0.1 mg/m^3 [soluble inorganic compound] TWA 0.2 mg/m^3 [insoluble inorganic compound] TWA 0.1 mg/m^3 [Nickel subsulfide]	Ca TWA 0.015 mg/m^3	TWA 1 mg/m^3	Ca [10 mg/m3 (as Ni)]	Inhalation, ingestion, skin and/or eye contact	Sensitization dermatitis, allergic asthma, pneumonitis; [potential occupational carcinogen]	Nasal cavities, lungs, skin	Lustrous, silvery, odorless solid. BP: 5139°F Fl.Pt. = NA LEL: NA UEL: NA Combustible Solid; nickel sponge catalyst may ignite spontaneously in air.
Potassium	9/7/7440	https://cameochemicals.noaa.gov/chemical/4289				Eye and/or skin contact	Will burn skin and eyes	Skin, eyes	Potassium is a soft silvery metal though normally grayish white due to oxidation BP: 1425°F Fl.Pt. = NA LEL: NA UEL: NA
Selenium	7782-49-2	TWA 0.2 mg/m3	TWA 0.2 mg/m3	TWA 0.2 mg/m3	1 mg/m3 (as Se)	Inhalation, ingestion, skin and/or eye contact	Irritation eyes, skin, nose, throat; visual disturbance; headache; chills, fever; dyspnea (breathing difficulty), bronchitis; metallic taste, garlic breath, gastrointestinal disturbance; dermatitis; eye, skin burns; In Animals: anemia; liver necrosis, cirrhosis; kidney, spleen damage	Eyes, skin, respiratory system, liver, kidneys, blood, spleen	Amorphous or crystalline, red to gray solid. [Note: Occurs as an impurity in most sulfide ores.] BP: 1265°F Fl.Pt. = NA LEL: NA UEL: NA Combustible Solid
Silver	7440-22-4	TWA 0.1 mg/m3 [Metal, dust, and fume] TWA 0.01 mg/m3 [Soluble compounds, as Ag]	TWA 0.01 mg/m3	TWA 0.01 mg/m3	10 mg/m3 (as Ag)	Inhalation, ingestion, skin and/or eye contact	Blue-gray eyes, nasal septum, throat, skin; irritation, ulceration skin; gastrointestinal disturbance	Nasal septum, skin, eyes	Metal: White, lustrous solid BP: 3632°F Fl.Pt. = NA LEL: NA UEL: NA Metal: Noncombustible Solid, but flammable in form of dust or powder
Sodium	7440-23-5	https://cameochemicals.noaa.gov/chemical/7794				Skin contact	Severe burns caused by burning metal or by caustic soda formed by reaction with moisture on skin	Skin	A silvery soft metal that becomes grayish white upon exposure to air BP: 1621°F Fl.Pt. = NA LEL: NA UEL: NA
Thallium	7440-28-0	0.02 mg/m3 inhallable particulate matter	TWA 0.1 mg/m3 [skin]	TWA 0.1 mg/m3 [skin]	15 mg/m3 (as Tl)	Inhalation, skin absorption, ingestion, skin and/or eye contact	Nausea, diarrhea, abdominal pain, vomiting; ptosis, strabismus; peri neuritis, tremor; retrosternal (occurring behind the sternum) tightness, chest pain, pulmonary edema; convulsions, chorea, psychosis; liver, kidney damage; alopecia; paresthesia legs	Eyes, respiratory system, central nervous system, liver, kidneys, gastrointestinal tract, body hair	Appearance and odor vary depending upon the specific soluble thallium compound BP: NA Fl.Pt. = NA LEL: NA UEL: NA
Vanadium	7440-62-2	https://cameochemicals.noaa.gov/chemical/16147				Inhalation, skin absorption, ingestion, skin and/or eye contact	Highly toxic, may be fatal if inhaled, swallowed or absorbed through skin. Avoid any skin contact. Effects of contact or inhalation may be delayed. Fire may produce irritating, corrosive and/or toxic gases. Runoff from fire control or dilution water may be corrosive and/or toxic and cause pollution	Skin	Silvery-whitish powder BP: NA Fl.Pt. = NA LEL: NA UEL: NA
Zinc	7440-66-6	https://cameochemicals.noaa.gov/chemical/4814				Inhalation, skin absorption, ingestion, skin and/or eye contact	Inhalation or contact with vapors, substance or decomposition products may cause severe injury or death. May produce corrosive solutions on contact with water. Fire will produce irritating, corrosive and/or toxic gases. Runoff from fire control may cause pollution	Lungs	A grayish powder BP: NA Fl.Pt. = NA LEL: NA UEL: NA
PCBs									
PCBs (total)	11097-69-1, 53469-21-9	TWA 0.5 mg/m3 [skin] TWA 1 mg/m3 [skin]	Ca TWA 0.001 mg/m3 Ca TWA 0.001 mg/m3	TWA 0.5 mg/m3 [skin] TWA 1 mg/m3 [skin]	Ca [5 mg/m3] Ca [5 mg/m3]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, chloracne; liver damage; reproductive effects; [potential occupational carcinogen]	Skin, eyes, liver, reproductive system	Colorless to pale-yellow, viscous liquid or solid (below 50°F) with a mild, hydrocarbon odor BP: 689-734°F, 617-691°F Fl.Pt. = NA, NA LEL: NA UEL: NA Nonflammable Liquid, but exposure in a fire results in the formation of a black soot containing PCBs, polychlorinated dibenzofurans, and chlorinated dibenzo-p-dioxins.

Table 1. Toxicological, Physical, and Chemical Properties of Compounds Potentially Present at 1360 E Main Street, Shrub Oak, New York.

Compound	CAS #	ACGIH TLV	NIOSH REL	OSHA PEL	IDLH	Routes of Exposure	Toxic Properties	Target Organs	Physical/Chemical Properties
Petroleum Hydrocarbons									
Gasoline	86290-81-5	TWA 300 ppm STEL 500 ppm	Ca	None	Ca [N.D.]	Inhalation, skin absorption, ingestion, skin and/or eye contact	Irritation eyes, skin, mucous membrane; dermatitis; headache, lassitude (weakness, exhaustion), blurred vision, dizziness, slurred speech, confusion, convulsions; chemical pneumonitis (aspiration liquid); possible liver, kidney damage; [potential occupational carcinogen]	Eyes, skin, respiratory system, central nervous system, liver, kidneys	Clear liquid with a characteristic odor BP: 102°F Fl.Pt. = -45°F LEL: 1.4% UEL: 7.6%

References


Centers for Disease Control and Prevention, 2018. *NIOSH Pocket Guide to Chemical Hazards.* The National Institute for Occupational Safety and Health.
American Conference of Governmental Industrial Hygienists (ACGIH), 2017. *2017 TLVs® and BEIs®.* Cincinnati, OH.
National Oceanic and Atmospheric Administration (NOAA) and Environmental Protection Agency (EPA), 2019. *CAMEO Chemicals Database* . https://cameochemicals.noaa.gov/
U.S. Department of Labor, 1990. *OSHA Regulated Hazardous Substances.* Industrial Exposure and Control Technologies Government Institutes, Inc.
Sax, N. Van Nostrand and Reinhold Company, 1987. *Hawley's Condensed Chemical Dictionary, 11th Edition.*
Proctor, N.H., J.P. Hughes and M.L. Fischman, 1989. *Chemical Hazards of the Workplace* . Van Nostrand Reinhold. New York.
Sax, N.I. and R.J. Lewis, 1989. *Dangerous Properties of Industrial Materials, 7th Edition.* Van Nostrand Reinhold. New York.

Abbreviations:

ACGIH – American Conference of Governmental Industrial Hygienists.
BP – boiling point at 1 atmosphere, °F
C – Ceiling, is a concentration that should not be exceeded during and part of the working exposure.
Ca – Carcinogenic.
CAS# - Chemical Abstracts Service registry number which is unique for each chemical.
DSEN - Dermal Sensitization
Ft Pt. – Flash point
IDLH - Immediately Dangerous to Life and Health concentrations represent the maximum concentration from which, in the event of respirator failure, one could escape within 30 minutes without a respirator and without experiencing any escape-impairing or irreversible health effects.
LEL – Lower explosive (flammable) limit in air, % by volume (at room temperature)
mg/m^3 – Milligrams of substance per cubic meter of air
NIOSH - National Institute for Occupational Safety and Health.
OSHA – Occupational Safety and Health Administration
OTO - Ototoxicant
PEL - OSHA Permissible Exposure Limit (usually) a time weighted average concentration that must not be exceeded during any 8 hour work shift of a 40 hr work week.
ppm – parts per million
REL – NIOSH Recommended Limit indicated a time weighted average concentration that must not be exceeded during any 10 hour work shift of a 40 hr work week
RSEN - Respiratory Sensitization
SG - Specific Gravity
STEL – ACGIH Short-term exposure limit (ST)
TLV - ACGIH Threshold Limit Values (usually 8 hour time weighted average concentrations).
TWA – 8-hour, time-weighted average
UEL – Upper explosive (flammable) limit in air, % by volume (at room temperature)
VP - Vapor Pressure

FIGURES

1. Site Location Map
2. Site Plan with Emergency Muster Area
3. Routes to Urgent Care and Hospital

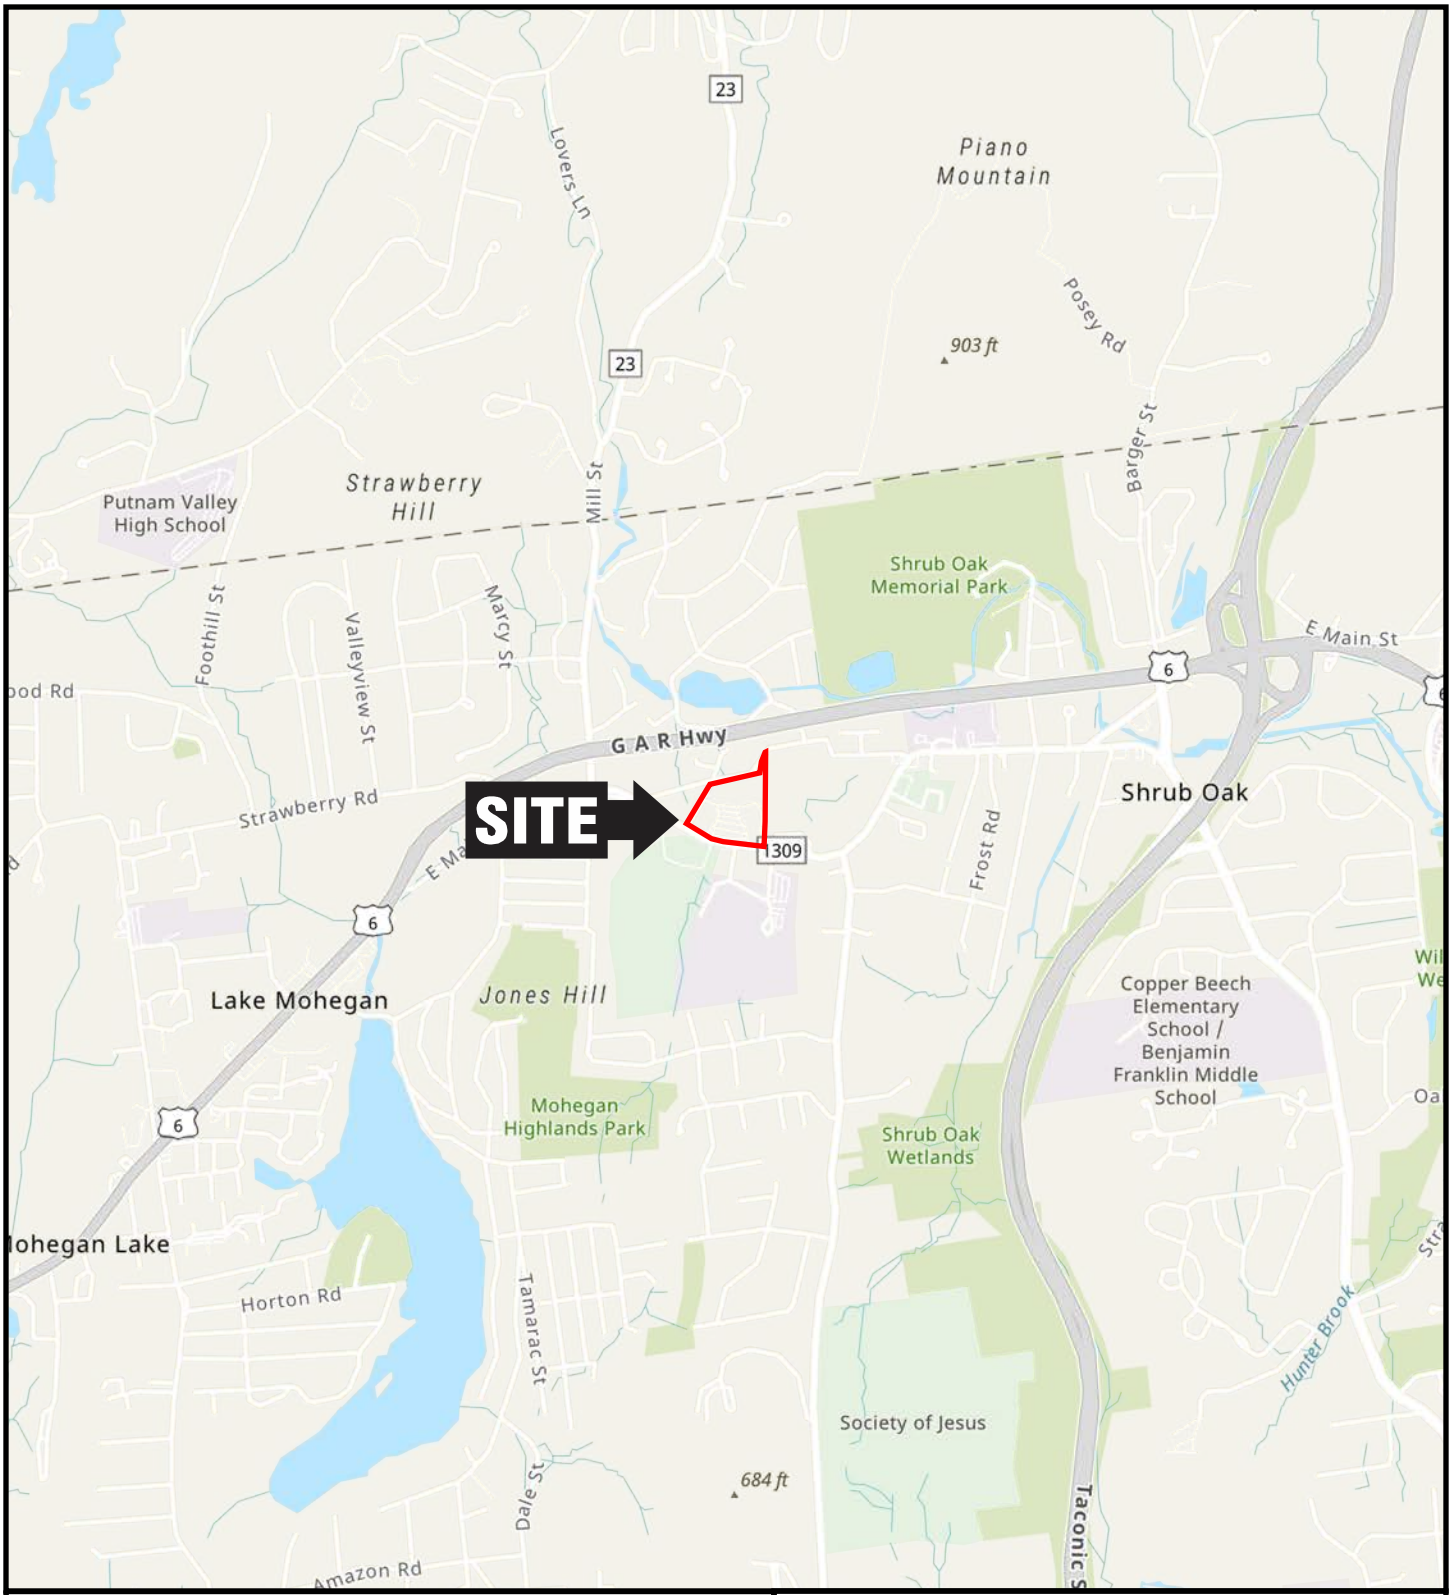

QUADRANGLE LOCATION



NOTES

Basemap: ESRI Topographic Map.

Easting (X): -73.750
Northing (Y): 41.250

N

2,000 0 2,000'

Title:

SITE LOCATION MAP

NYSDEC BCP SITE NO. C360117
MR. CLEANERS - SHRUB OAK SHOPPING CENTER
1360 EAST MAIN STREET, SHRUB OAK, NEW YORK


Prepared for:

SHRUB OAK PARTNERS LLC

ROUX

Compiled by: M.O.	Date: 07/14/26	FIGURE
Prepared by: M.S.R.	Scale: AS SHOWN	1
Project Mgr: M.O.	Project: 3950.0001Y000	
File: 3950.0001Y133.01		

V:\GIS\PROJECTS\3950\0001Y\133\3950000 1Y133.APRX

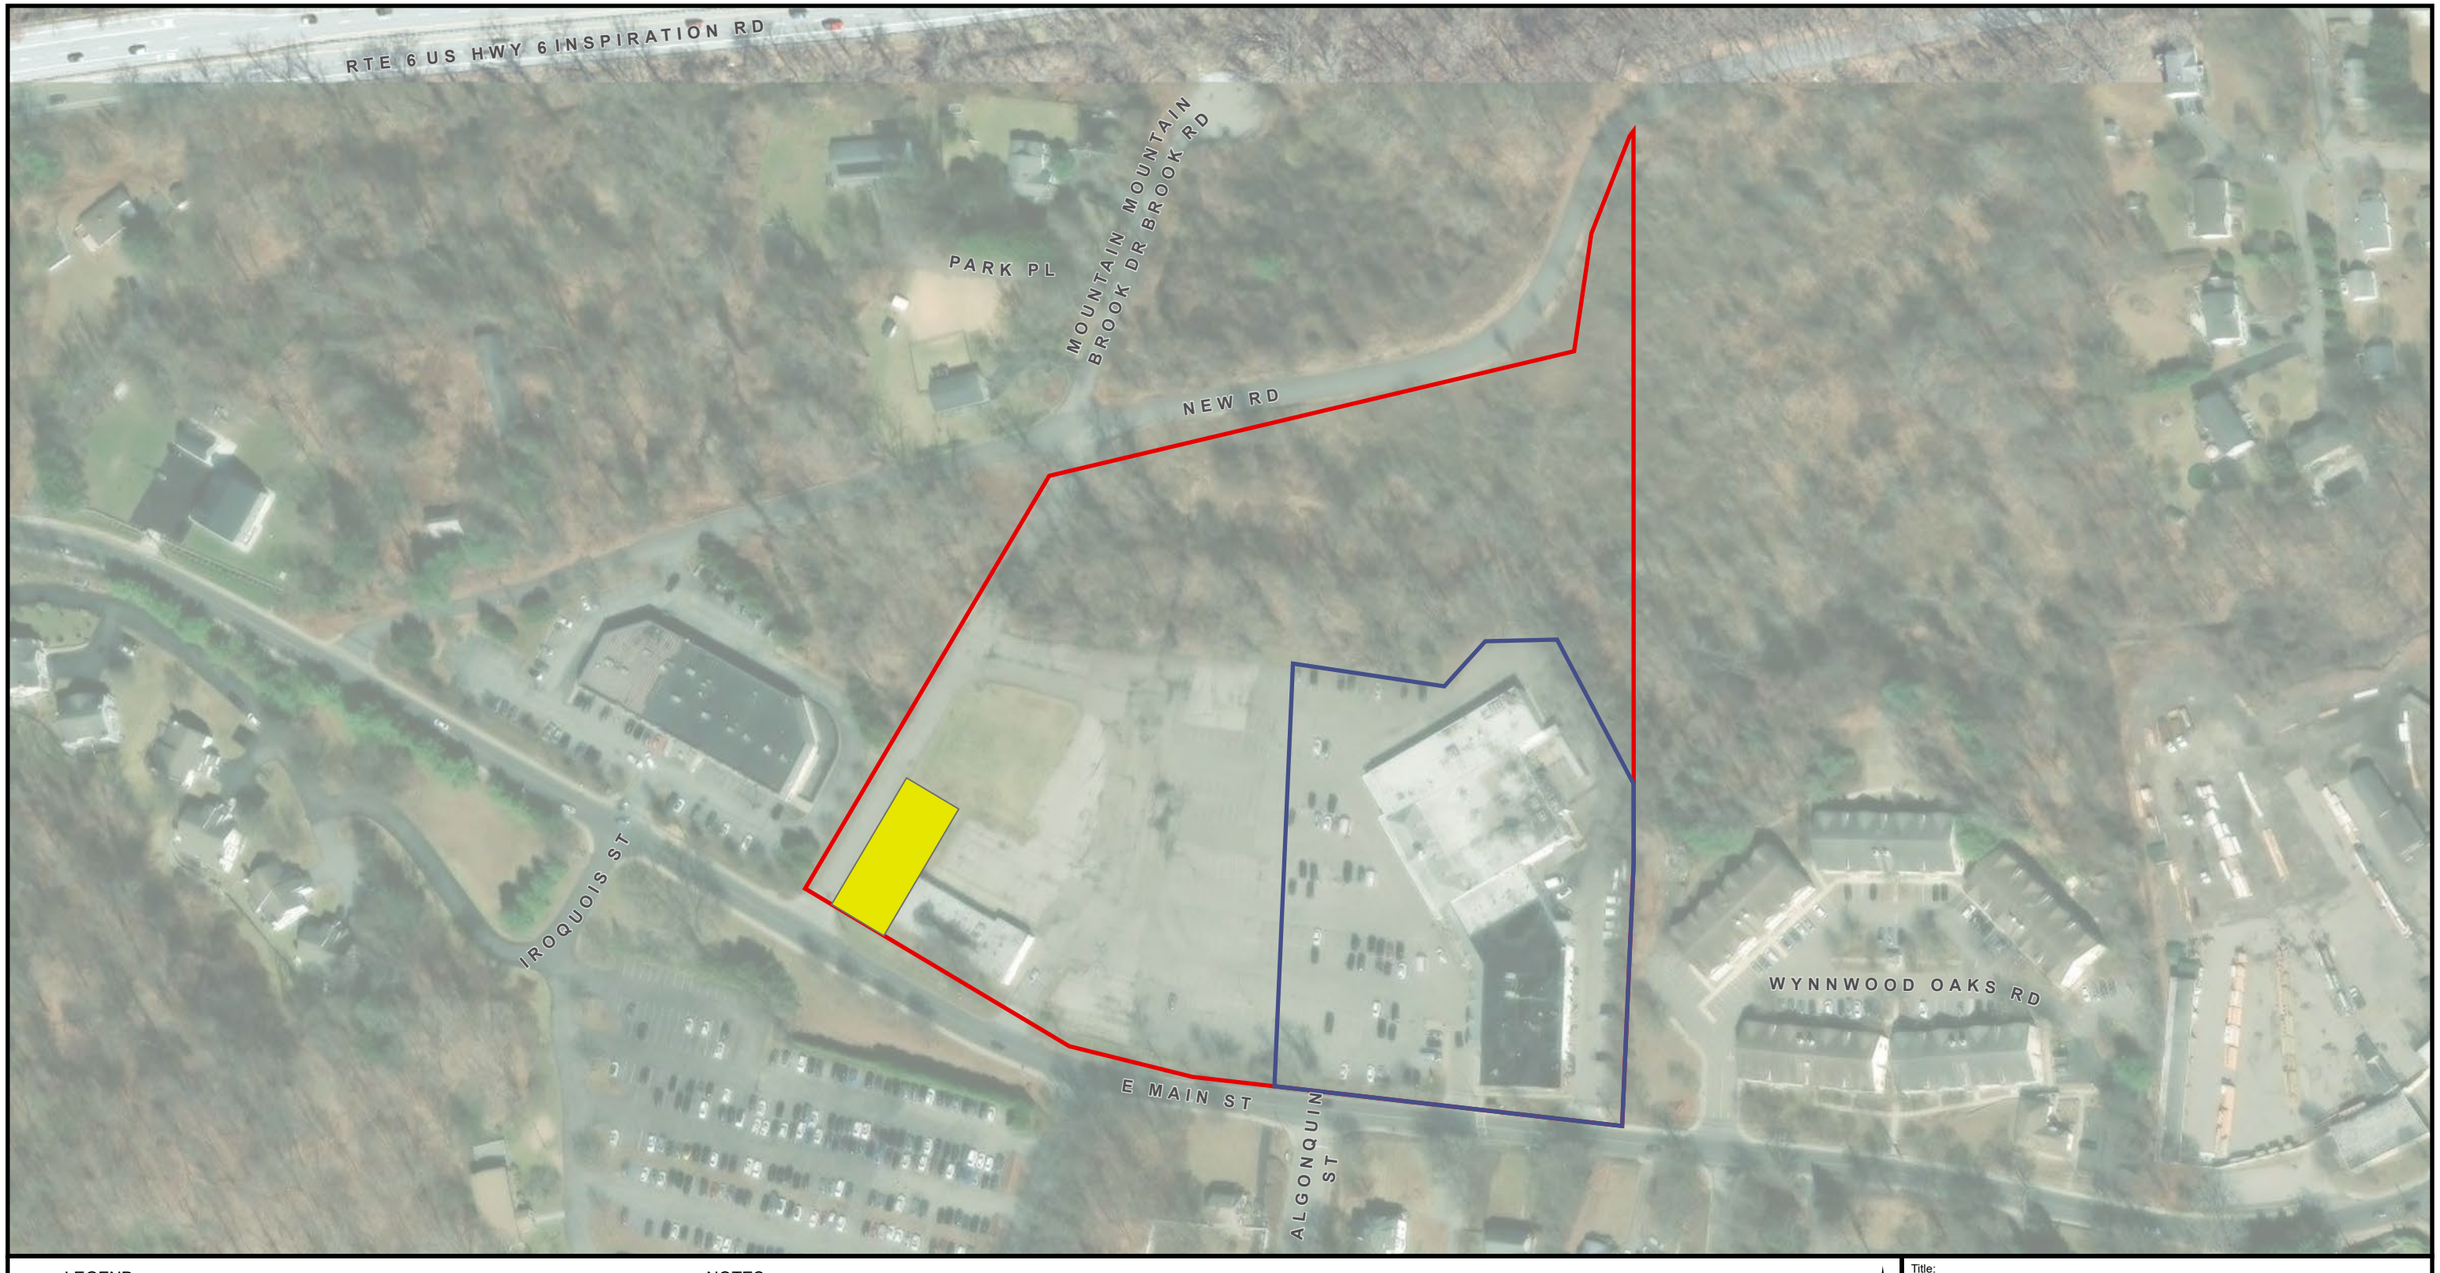

LEGEND

- EMERGENCY MUSTER AREA
- BROWNFIELD CLEANUP PROGRAM SITE NO.C360117 BOUNDARY
- SUBJECT PROPERTY BOUNDARY

NOTES
1. AERIAL SOURCE: ESRI WORLD IMAGERY BASEMAP

N

150 0 150'

Title:

SITE PLAN AND EMERGENCY MUSTER AREA

NYSDEC BCP SITE NO. C360117
MR. CLEANERS - SHRUB OAK SHOPPING CENTER
1360 EAST MAIN STREET, SHRUB OAK, NEW YORK


Prepared for:

SHRUB OAK PARTNERS LLC

ROUX

Compiled by: M.O.	Date: 07/14/26	FIGURE
Prepared by: M.S.R.	Scale: AS SHOWN	2
Project Mgr: M.O.	Project: 3950.0001Y000	
File: 3950.0001Y133.02		

V:\GIS\PROJECTS\3950\0001Y\133\3950001Y133.APRX

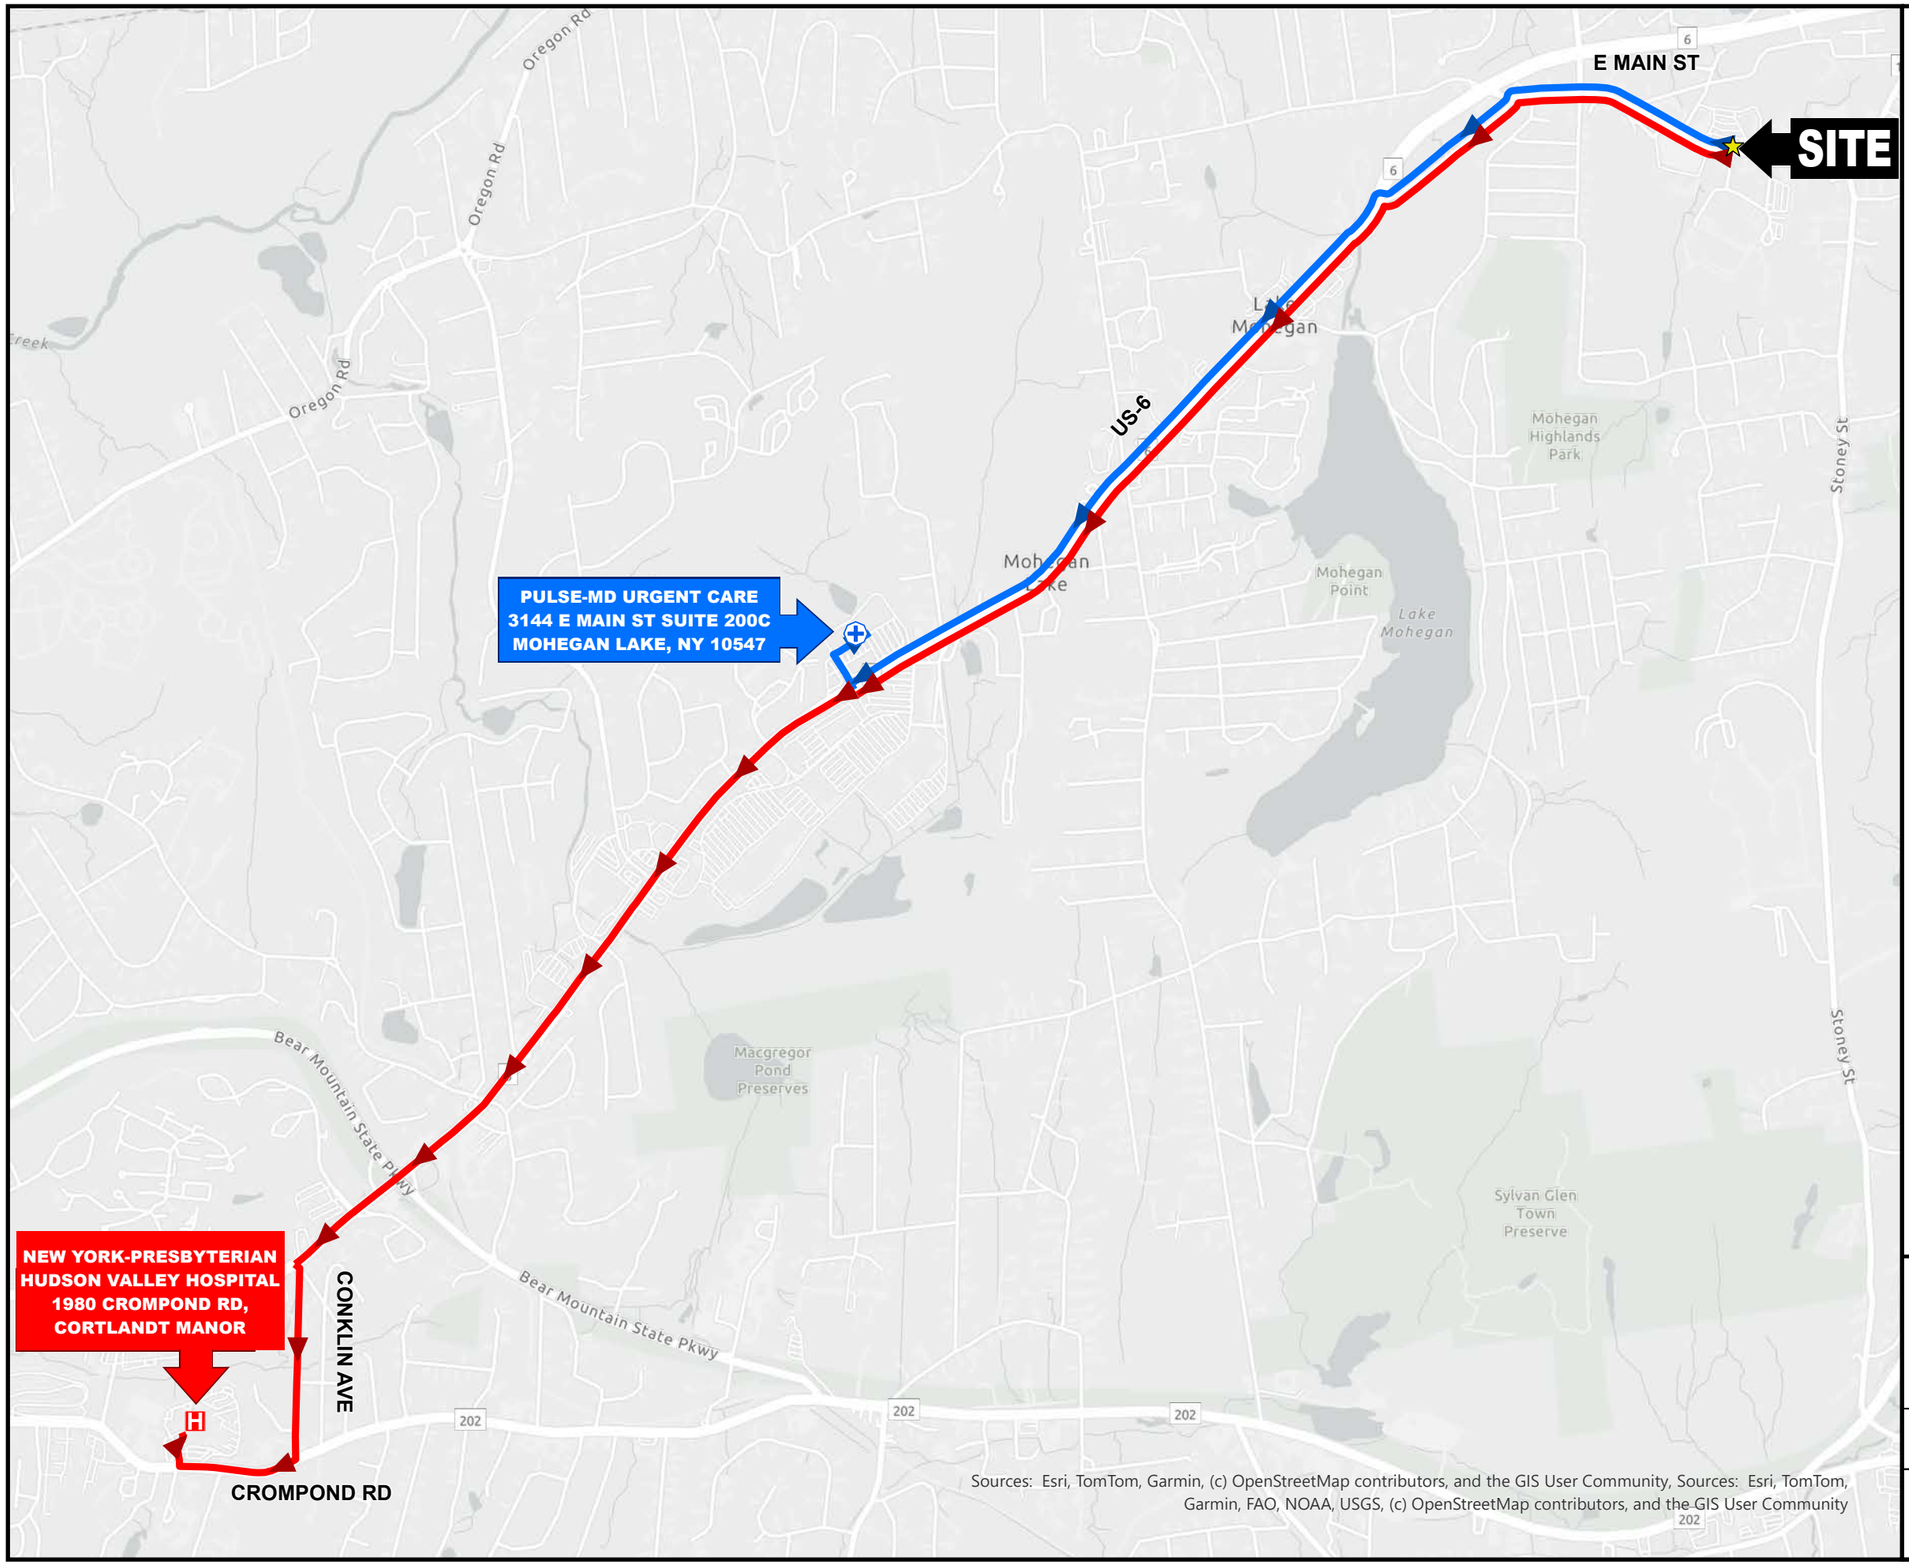

Sources: Esri, TomTom, Garmin, (c) OpenStreetMap contributors, and the GIS User Community, Sources: Esri, TomTom, Garmin, FAO, NOAA, USGS, (c) OpenStreetMap contributors, and the GIS User Community

N

DIRECTIONS TO HOSPITAL

1. TURN RIGHT ONTO 1309/E MAIN ST
2. TURN LEFT ONTO E MAIN ST
3. TURN LEFT ONTO US-6 W/E MAIN ST
4. TURN LEFT ONTO CONKLIN AVE
5. TURN RIGHT ONTO CROMPOND RD
6. TURN RIGHT INTO HOSPITAL COMPLEX
7. DESTINATION WILL BE ON THE RIGHT

DIRECTIONS TO URGENT CARE

1. TURN RIGHT ONTO 1309/E MAIN ST
2. TURN LEFT ONTO E MAIN ST
3. TURN LEFT ONTO US-6 W/E MAIN ST
4. DESTINATION WILL BE ON THE RIGHT

1,500 0 1,500
Feet

Title:

ROUTES TO URGENT CARE AND HOSPITAL

NYSDEC BCP SITE NO. C360117
MR. CLEANERS - SHRUB OAK SHOPPING CENTER
1360 EAST MAIN STREET, SHRUB OAK, NEW YORK

Prepared for:

SHRUB OAK PARTNERS LLC

ROUX

Compiled by: M.O.	Date: 07/14/26	FIGURE
Prepared by: M.S.R.	Scale: AS SHOWN	3
Project Mgr: M.O.	Project: 3950.0001Y000	
File: 3950.0001Y133.03		

V:\GIS\Projects\3950\0001Y\133\395000011Y133.aprx

APPENDICES

A. Job Safety Analysis (JSA) Forms
B. Safety Data Sheets (SDSs) for Chemicals Used
C. Heat Illness Prevention Program
D. Personal Protective Equipment (PPE) Management Program
E. Subsurface Utility Clearance Management Program
F. Heavy Equipment Exclusion Zone Policy

APPENDIX A

Job Safety Analysis (JSA) Forms

JOB SAFETY ANALYSIS	Ctrl. No. GEN-006	DATE 05/22/2025	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY:	WORK TYPE:	WORK ACTIVITY (Description):
Generic	**Drilling**	**Direct Push Soil Borings / Well Installation**

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☐ GOGGLES ☐ FACE SHIELD ☒ HEARING PROTECTION: (as needed) ☒ SAFETY SHOES: Composite-toe or steel-toe boots	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: Fluorescent reflective vest or high visibility clothing, long-sleeved shirt	☒ GLOVES: Nitrile and cut-resistant ☒ OTHER: Insect Repellant, sunscreen (as needed)

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Geoprobe or Truck-Mounted Direct Push Drill Rig, Hand Tools, Photoionization Detector, Multi-Gas Meter (or equivalent), Macrocore liners, Liner Opening Tool, 20 lb. Type ABC Fire Extinguisher, 42" Cones & traffic control paddles, "Work Area" Signs, Water.

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing LMRAs

EXCLUSION ZONE (EZ): Maintain a Minimum Heavy Equipment Exclusion Zone around equipment and loads while in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, the tip zone of the equipment, the fall zone of the equipment, and the contents.

"SHOW ME YOUR HANDS"
The driller and helper should show that their hands are clear of controls and moving parts.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Mobilization of drilling rig (ensure the Subsurface Clearance Protocol and Drill Rig Checklist are completed)	**1a. CONTACT:** Equipment/property damage.	1a. The drill rig's tower/derrick will be lowered and secured before mobilization. 1a. A spotter should be utilized while moving the drill rig. If personnel move into the path of the drill rig, the drill rig will be stopped until the path is again clear. Use a spotter for all required backing operations. 1a. Set up the work area and position equipment to eliminate or reduce the need for backing support trucks and trailers. 1a. When backing up the truck rig with an attached trailer, use a second spotter if there is tight clearance simultaneously on multiple sides of the equipment or if turning angles limit driver visibility.
Secure Work Zone		1a. Inspect the driving path for uneven terrain. Level or avoid if needed. 1a. Ensure the work area is secure and inform others of work activity. Establish a HEEZ using traffic cones, barrels & snow fencing or telescoping poles. Use flag persons to maintain clear traffic and minimize motorist confusion during set-up. HEEZ is to include the tip/swing radius of the equipment.
	1b. FALL: Slip/trip/fall hazards.	1b. Inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions before mobilizing equipment. 1b. Do not climb over stored materials/equipment; walk around. Practice good housekeeping. 1b. Use established pathways and walk on stable, secure ground.
	1c. CONTACT: Crushing from a rollover.	1c Geoprobe should cross all hills/obstructions head-on with the mast down to reduce the risk of rollover.
2. Raising the tower/derrick of the drill rig	**2a. CONTACT:** Overhead hazards.	2a. Before raising the tower/derrick, the area above the drilling rig will be inspected for wires, tree limbs, piping, or other structures that could come in contact with the rig's tower and/or drilling rods or tools. 2a. Maintain a minimum safe distance of 10' from overhead lines, material, or structures.
	2b. CONTACT: Pinch Points/Amputation Points when raising the rig, and the instability of the rig	2b. Inspect the equipment before use and avoid pinch/amputation points. 2b. Lower outriggers to ensure stability before raising the rig tower/derrick. 2b. If the rig needs to be mounted, use three points of contact.
3. Advancement of drilling equipment and sound installation	**3a. CONTACT:** Flying debris	3a. Be aware of and avoid potential line-of-fire hazards and wear required PPE such as eye, ear, and hand protection.
	3b. EXPOSURE: Noise and dust.	3b. Wet borehole area with sprayer to minimize dust. 3b. Stand upwind and keep your body away from the rig. 3b. If conditions warrant, a disposable dust mask (e.g., N95/P100) should be worn. 3b. Wear hearing protection when the drill rig is in operation.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
3. Advancement of drilling equipment and well installation (Continued)	**3c. FALL:** Slip/trip/fall hazards.	3c. Contain drill cuttings and drilling water to prevent fall hazards from developing in the work area. 3c. See 1b.
	3d. CAUGHT: Limb/extremity pinching; abrasion/crushing.	3d. Ensure all Emergency Safety Stop buttons function properly. 3d. Always wear leather gloves when making connections and using hand tools; wear cut-resistant (i.e., Kevlar) gloves when handling cutting tools. 3d. Inspect the equipment prior to use for potential pinch/amputation points. Keep hands away from pinch/amputation points, and the use of tools is preferable compared to fingers and hands. 3d. Inspect the drill head for worn surface or missing teeth; replace it if damaged or blunt. 3d. Ensure all jewelry is removed, loose clothing is secured, and PPE is correctly fitted and secured close to the body. 3d. All non-essential personnel should stay away from the immediate work area; position the body out of the line-of-fire of equipment. 3d. Drillers and helpers will understand and use the "Show Me Your Hands" Policy. 3d. Spinning rods/casing have an **exclusion zone of 24 inches** while in operation.
	3e. CONTACT: Equipment imbalance during the advancement of drill equipment.	3e. Drillers will advance the borehole with caution to avoid causing the rig to become imbalanced and/or tip. 3e. The blocking and leveling devices used to secure the rig will be inspected by drillers and Roux personnel regularly to see if shifting has occurred. 3e. In addition, personnel and equipment that are non-essential to the advancement of the borehole will be positioned away from the rig at a distance that is at least as far as the boom is high (**minimum exclusion zone**).
	3f. EXPOSURE: Inhalation of contamination/vapors.	3f. Monitor ambient air for dangerous conditions using a calibrated photoionization detector (PID) to monitor the breathing zone of the work area. 3f. If a reading of >5ppm is recorded, the Roux field personnel must temporarily cease work, instruct all Site personnel to step away from the area of elevated readings, and inform the Roux PM of the condition. The Roux PM will then recommend additional precautions in accordance with the site-specific health and safety plan. 3f. Use a multi-gas meter to monitor ambient air for dangerous conditions (i.e., unsafe levels of carbon monoxide when drilling indoors or the presence of explosive vapors).
	3g. EXERTION: Potential for muscle strain/injury while lifting and installing well casings, lifting sand bags, and/or lifting rods.	3g. Keep your back straight and bend at the knees. 3g. Utilize team lifting or mechanical means for objects over 40 lbs. 3g. Use a mechanical lifting device for odd-shaped objects.
4. Remove the sample liner.	**4a. EXERTION:** Potential for muscle strain/injury while removing the liner from the probe rod.	4a Utilize team lifting or mechanical means for objects over 40 lbs. 4a. Use the hydraulic liner extruder if available.
	4b. CONTACT: Pinch points and cuts	4b. Place the liner on the sturdy surface when opening. 4b. Don cut-resistant gloves and use an appropriate liner cutter when opening liners. 4b. Always cut away from the body.
	4c. EXPOSURE: Inhalation and/or dermal contact with contaminants.	4c. Wear chemical-resistant disposable gloves when handling liners. 4c. See 3f.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
5. Decontaminate equipment.	**5a. EXPOSURE/CONTACT**: To contamination (e.g., Separate Phase Hydrocarbons (SPH), contaminated groundwater, vapors).	5a. Wear chemical-resistant disposable gloves and safety glasses. 5a. Contain decontamination water so that it does not spill. 5a. Use an absorbent pad to clean spills, if necessary. 5a. Spray equipment from a side angle, not straight on, to avoid backsplash. 5a. See 3b and 3f.
	5b. EXPOSURE: The chemicals in the cleaning solution.	5b. See 4a. Review the SDS to ensure appropriate precautions are taken and understood.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-007	DATE 05/22/2025	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
GENERIC	**General Site Activity**	**Driving**

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☐ HARD HAT: when outside vehicle ☐ LIFELINE / BODY HARNESS ☐ SAFETY GLASSES: when outside vehicle	☐ GOGGLES ☐ FACE SHIELD ☐ HEARING PROTECTION ☐ SAFETY TOE BOOTS: when outside vehicle	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☐ PPE CLOTHING: high visibility vest when outside vehicle	☐ GLOVES: Leather/ cut-resistant level 2 ☐ OTHER _____

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Motor Vehicle (i.e., car, truck, SUV)

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing LMRAs

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Driving to/leaving the Site	**1a. CONTACT:** Severe injury/disability, property damage, monetary loss (insurance premiums, deductibles, loss of license/job) caused by collision with or struck by other vehicles, obstructions, pedestrians, animals, etc. *Common factors that may lead to a CONTACT incident, but not limited to: • distracted driving (cell phone, GPS, radio, billboards, "rubbernecking") • lack of situational awareness • unfamiliarity with traffic patterns/road layout • weather conditions (wet/icy roads, hydroplaning, black ice) • weariness • high speeds • obstructed vision (solar glare, debris on windshield, blind spots, large vehicle at the front) • changes in travel pathway (construction, snow banks, non-operational signals, potholes, detours, special events) • improper vehicle maintenance (non-operational signal light, worn tires, cracked windshield, ineffective wipers) • loose or unsecure objects	1a. PLAN AHEAD – review/make yourself familiar with maps and driving directions before beginning the drive to the Site. Do not attempt to drive and review maps/directions at the same time. Pull over and stop your vehicle before looking at maps/directions. 1a. If a Roux vehicle or a Roux-rented vehicle, complete a vehicle inspection form. If a personal vehicle, complete a basic 360 vehicle inspection before driving. Verify Inspection and Registration are current, tires and wipers are in good condition, all lights are functional, all glass/mirrors are undamaged, the horn is functional, roof/hood/trunk are free from accumulated snow, and visibility is not impaired due to snow/ice/frost/fog on windows. 1a. Do not hang items in the car that can obstruct your view or become projectiles in a collision. 1a. Do not get distracted using touch screen radios or GPS units built into newer models. Keep your eyes on the road and stay alert. 1a. Follow posted speed limits and obey traffic signals and roadway signs. 1a. Always wear your seat belt and shoulder harness when driving. 1a. When driving around large vehicles and trucks, maintain extra space as these vehicles may not be able to see a smaller car too close. 1a. Follow the "Rules of the Road," including: using your turn signals, coming to a complete stop, and allowing vehicles the right of way (yield) when required by traffic laws. 1a. Apply the Smith Five Keys® of safe driving • Aim High in Steering® - Expand eye lead time to a minimum of 15 seconds • Get the Big Picture® - Maintain a proper 4-second minimum following distance at all times - Scan mirrors every 5-8 seconds to achieve a circle of awareness - Position your vehicle so you can see relevant/non-relevant objects • Keep Your Eyes Moving® - Try to maintain about 180 degrees of visibility - Avoid blank and fixed stares. Avoid focusing on one object for more than 2 seconds • Leave Yourself an Out® - Avoid traveling in traffic clusters - Surround yourself with space - Anticipate the actions of others

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Driving to/leaving Site (cont'd)	**1a. CONTACT:** Severe injury/disability, property damage, monetary loss (insurance premiums, deductibles, loss of license/job) caused by collision with or struck by other vehicles, obstructions, pedestrians, animals, etc.	• Make Sure They See You® - Maintain eye contact with oncoming vehicles/pedestrians - Use warning devices (e.g., hand signals, high-lights, horns, etc.) - Proper timing is essential 1a. Do not perform reconnaissance or inspections while driving. Your vehicle should be parked in a safe location when viewing or surveying the Site and vicinity 1a. Avoid sudden turns and stops. Do not drive recklessly – be in control of the vehicle at all times. 1a. In inclement weather, first determine if work can be POSTPONED. Otherwise, plan according to weather conditions, including checking the forecast along the entirety of the travel route (especially for long distances). Reduce speed as road conditions warrant. Travelling with winter car equipment in the winter is strongly recommended (i.e., shovel, scraper, brush, blanket, extra clothing, flashlight, bag of sand). If your vehicle has 4-wheel drive, review the operator's manual and understand the operating procedure prior to engaging 4-wheel drive. If at any point on your drive, the weather becomes too severe to proceed safely, pull over if safe to do so or seek nearest cover (e.g., overpass) 1a. If feeling drowsy or sleepy, do not drive. Pull over in a safe place to rest if you experience any signs of drowsiness. Make sure to get adequate sleep the night before an early drive. 1a. Never operate a vehicle under the influence of alcohol, illegal substances, or medications affecting your performance. 1a. Keep your eyes on the road. Do not call, text, or talk on cellular phones. Pull over to a safe location if you must answer or make a call. 1a. When parking, pull through when possible. If backing is required, visually inspect the area to ensure it is free from obstructions prior to backing in and relying solely on mirrors; use spotters when available.
2. Entering/Exiting Vehicle.	**2a. CAUGHT:** Personal injury (broken fingers/hand) while entering or exiting vehicles **2b. FALL:** Personal injury (twisted ankle, deep contusion, concussion, broken wrist/arm, etc.) from a slip/fall on an uneven, unstable, or slippery surface while exiting/entering the vehicle **2c. CONTACT:** Severe injury/disability, property damage, monetary loss (insurance premiums, deductibles, loss of license/job) caused by collision with or struck by other vehicles, obstructions, pedestrians, animals, etc.	2a. Open and close doors slowly. Never put hands or feet in between the door and the vehicle to avoid pinch points. 2b. When exiting the vehicle, make sure your feet are on firm footing and weight is evenly distributed before exiting/standing. In inclement weather, use your hands to support yourself by holding the car door and/or steering wheel when exiting the vehicle. 2c. Check both directions for traffic before opening the door. Do not exit the vehicle if traffic does not permit you to exit safely 2c. Check the anticipated path of the door prior to opening. Do not open the door into any obstructions (e.g., bollards, high curbs)

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-009	DATE: 05/23/2025	☐ NEW ☒ REVISED	PAGE 1 of 1
JSA TYPE CATEGORY **Generic**	WORK TYPE **O&M**	WORK ACTIVITY (Description) **Movement of 55-Gallon Drums/Drum Handling with Mobile Carrier**		

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST	☐ GOGGLES	☐ AIR PURIFYING RESPIRATOR	☒ GLOVES: Cut-resistant gloves level II
☒ HARD HAT	☐ FACE SHIELD	☐ SUPPLIED RESPIRATOR	☐ OTHER:
☐ LIFELINE / BODY HARNESS	☐ HEARING PROTECTION	☒ PPE CLOTHING: Fluorescent long-sleeve shirt or shirt and reflective safety vest.	
☒ SAFETY GLASSES	☒ SAFETY SHOES: Steel or composite toe		

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Mobile Drum Carrier, over-pack drum container, safety cones, and caution tape

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing LMRAs

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Preparing for an Inspection of the Drum	**1a. FALL:** Tripping/falling due to uneven surface. Loose debris/garbage in the work area.	1a. Clear the area of loose garbage and debris. Inspect 55-gal drums for proper condition, labeling, check drum ring and bolts for tightness, and inspect mobile drum carrier. 1a. Do a Test Lift to get a general sense of the weight of the drum. 1a. Inspect and use established pathways to avoid uneven terrain, weather-related hazards (i.e., debris, puddles, ice, etc.), and other obstructions. 1a. Secure a work area and coordinate and communicate the planned work activities with other personnel working in the area. 1a. Delineate work area with safety cones and caution tape
	1b. CONTACT/EXPOSURE: Drums could potentially be damaged or contain hazardous material. A mobile drum carrier could potentially be in poor working condition, causing malfunctioning during operation.	1b. Prior to inspecting drums, don cut-resistant gloves. If the drum is not properly labeled, do not open it and cease all drum transport activities. Immediately contact the project manager and inform him/her of the drum situation. 1b. Do not continue drum transport activities until the project manager determines further actions. 1b. If the drum is properly labeled, but leaking, improperly sealed, or in poor condition, place the drum in an overpack drum. 1b. Inspect the mobile drum carrier to ensure its overall integrity. Look for rust marks or potential weak points where the drum carrier could malfunction. Inspect the wheels to ensure that they easily turn and nothing is impeding their movement.
	1c. EXERTION/CAUGHT: Potential pinching/exertion hazards while securing the ring/ tightening bolts	1c. Keep back straight and knees slightly bent while securing the drum ring/tightening bolt. Wear cut-resistant gloves.
2. Position the drum clamp tightly in between the drum ribs, securing the drum clamp to the drum with the chain	**2a. CAUGHT:** Pinching fingers between the drum clamp and the handle/chain.	2a. Attach drum clamp with chain and tighten until snug. Do not place hands between the drum clamp and the drum as the chain is tightened; wear cut-resistant gloves. Keep face away from the drum when handling in case of escaping vapors.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
3. Disengage safety latches on handle, pull handle down until drum is lifted off the ground, and safety latches are reengaged; slightly suspend drum off the ground	**3a. EXERTION/ CONTACT:** Potential muscle strain associated with lifting/engaging the drum/handle. The drum could shift/slip downward and crush toes.	3a. Ascertain whether the drum is overweight; if it is, then two people are needed to lower the handle while the drum is secured with the clamp so that safety latches can be engaged. Keep body out of the line-of-fire of the handle (do not position the head above the handle) as it is being pushed down. Do not allow feet/toes to be positioned under the drum as it is being lifted; wear steel/composite-toed boots.
	3b. CAUGHT: Fingers could be pinched while engaging/disengaging the safety latches on the handle	3b. Wear cut-resistant gloves while disengaging/reengaging safety latches. 3b. Avoid placing hands in pinch points.
4. Transport drums to the designated location and disengage the drum clamp (repeat Step 3 in reverse order)	**4a. FALL:** Tripping/ falling due to obstructions and uneven terrain. Potential for the drum to fall during transport.	4a. Ensure the transport path is free of potential obstructions that may cause the drum/carrier to become unstable. Position the drum clamp between the ribs on the drum to prevent possible slipping.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

JOB SAFETY ANALYSIS Ctrl. No. GEN-013	DATE 05/28/2025	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE:	WORK ACTIVITY (Description):
Generic	**Gauging and Sampling**	**Gauging and Sampling**

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☒ LIFE VEST	☐ GOGGLES	☐ AIR PURIFYING RESPIRATOR	☒ GLOVES: , Nitrile and cut-resistant level II
☒ HARD HAT	☐ FACE SHIELD	☐ SUPPLIED RESPIRATOR	
☐ LIFELINE / BODY HARNESS	☐ HEARING PROTECTION	☒ PPE CLOTHING: Fluorescent reflective vest or high visibility clothing	☒ OTHER: Knee pads, Insect Repellant, sunscreen (as needed)
☒ SAFETY GLASSES	☒ SAFETY SHOES: Composite-toed or steel-toed boots		

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Traffic Safety Cones, Caution Tape, Interface Probe with Ground Clamp, and/or Water Level Meter, 20-lb. type ABC Fire Extinguisher, Buckets. Tools as needed: Socket Wrench, Screw Driver, Crow Bar, Mallet, and Wire Brush.

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing LMRAs

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Mobilization to monitoring well(s).	**1a. FALL:** Personal injury from slip/trip/fall due to uneven terrain and/or obstructions.	1a. Inspect the pathway and plan for the most suitable designated pathway prior to mobilization. 1a. Use established pathways, walk and/or drive on stable, secure ground, and avoid steep hills or uneven terrain. 1a. If working near open water with an unguarded edge, wear a personal flotation device (PFD).
	1b. CONTACT: With traffic/third parties.	1b. Identify potential traffic sources and delineate the work area with traffic safety cones. Position the vehicle to protect against oncoming traffic. Use caution tape to provide a more visible delineation of the work area if necessary. 1b. Wear appropriate PPE, including high visibility clothing and reflective vest, when exposed to traffic 1b. Face traffic, maintain eye contact with oncoming vehicles, and establish a safe exit route.
	1c. EXERTION: Muscle strain from lifting equipment	1c. Use proper lifting techniques when handling/moving equipment; bend knees and keep back straight. 1c. Use mechanical assistance or team lifting techniques when equipment is 40 lbs. or heavier. 1c. Make multiple trips to carry equipment.
	1d. EXPOSURE: To biological hazards.	1d. Inspect work area for bees and insects. 1d. Use insect/tick repellent, as necessary. 1d. Treat clothing with permethrin prior to mobilization. 1d. Don Tyvek/mosquito nets, as applicable.
2. Open/close well.	**2a. EXERTION:** Muscle strain.	2a. Use proper lifting techniques; keep back straight, lift with legs, and bend knees when reaching to open/close the well.
	2b. CAUGHT: Pinch/crush points associated with removing/replacing manholes and working with hand tools.	2b. Wear cut-resistant level II gloves when working with well cover and hand tools. 2b. Use proper tools (ratchet and pry bar or magnet for well cover) and inspect before use. 2b. Do not put fingers under the well cover.
	2c. CAUGHT: Pinch points associated with placing the J-plug back onto the PVC pipe.	2c. See 2b. 2c. Keep fingers out of line-of-fire when securing cap.
	2d. EXPOSURE: To potential hazardous vapors.	2d. No open flames/heat sources. 2d. To minimize exposure to vapors, allow the well to vent after opening it and before sampling activities begin. 2d. Stand upwind if possible, to avoid inhaling vapors. 2d. Monitor atmosphere with multi-gas meter/PID.
3. Gauge well.	**3a. CONTACT:** With contamination (e.g., contaminated groundwater).	3a. Wear chemical-resistant disposable gloves (over cut-resistant gloves) and safety glasses when gauging well. 3a. Insert and remove the probe slowly to avoid splashing. 3a. Use an absorbent pad to clean probe.
	3b. CONTACT: With traffic.	3b. See 1b.
	3c. Exposure: To static electricity, fire, or explosion.	3c. Ground interface probe to a designated grounding point/rod, well casing, or electrically conductive surface to dissipate static electricity.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
4. Purge and sample well	**4a. EXPOSURE/CONTACT:** To contamination (e.g., SPH, contaminated groundwater, vapors) and/or sample preservatives.	4a. Open and fill sample jars slowly to avoid splashing and contact with preservatives. 4a. Wear cut-resistant gloves and chemical-resistant disposable gloves when sampling. 4a. Fill sample containers over the purge container to avoid spilling water onto the ground. 4a. Use an absorbent pad to clean spills. 4a. When using a bailer to purge a well, pull the bailer slowly from the well to avoid splash hazards. 4a. When sampling or purging the water using a bailer, pour water slowly to reduce the potential for splash hazards with groundwater. 4a. When using a tubing valve, always remove the valve slowly after sample collection to release any pressure and avoid pressurized splash hazards. 4a. When collecting a groundwater sample, always point the sampling apparatus (tubing, bailer, etc.) away from the face and body.
	4b. CONTACT: Personal injury from cuts, abrasions, or punctures by glassware or sharp objects.	4b. To avoid spills or breakage, place sampleware on an even surface. 4b. Do not over-tighten caps on glass sampleware. 4b. Wear chemical-resistant nitrile disposable gloves over cut-resistant (i.e., Kevlar) gloves when sampling and handling glassware (i.e., VOA vials) or when using approved cutting tools.
	4c. EXERTION: Muscle strain while carrying equipment.	4c. Use proper lifting techniques when handling/moving equipment, bend knees, and keep back straight. 4c. Use mechanical assistance or team lifting techniques when equipment is 40 lbs. or heavier. 4c. Make multiple trips to carry equipment.
	4d. CONTACT: With traffic.	4d. See 1b.
	4e. CONTACT: Pinch points with groundwater pump components (i.e., wheel, line, clamps).	4e. Wear cut-resistant gloves when working with groundwater pumps. 4e. Never place hands on or near pinch points such as the wheel, clamps, or other moving parts during pump operations. 4e. Use the correct mechanisms, such as a pump reel, to lower the pump into the well. 4e. Never attempt to manually stop any moving part of equipment, including hose reels and/or tubing.
	4f. EXERTION: Muscle strain from repetitive motion of bailing and sampling a well.	4f. See 4c. 4f. Include a stretch break when repetitive motions are part of the task.
5. Management of purge water.	**5a. EXPOSURE/CONTACT:** To contamination (e.g., SPH, contaminated groundwater, vapors).	5a. Do not overfill the container, and pour liquids slowly so that they do not splash. 5a. Properly dispose of used materials/PPE in an appropriate container in the designated storage area.
	5b. EXERTION: Muscle strain from lifting/carrying, and moving containers.	5b. Use proper lifting techniques when lifting/carrying or moving container(s) (see 4c.). 5b. Do not overfill container(s).
6. Decontaminate equipment.	**6a. EXPOSURE/CONTACT:** To contamination (e.g., SPH, contaminated groundwater, vapors).	6a. Work on the upwind side, where possible, of the decon area. 6a. Wear chemical-resistant disposable gloves and safety glasses. 6a. Use an absorbent pad to clean spills.
	6b. CAUGHT: Pinch points associated with handling hand tools	6b. See 2b. 6b. Inspect hand tools for sharp edges before decontaminating.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-014	DATE: 05/28/2025	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY:	WORK TYPE:	WORK ACTIVITY (Description):
Generic	**Drilling**	**Hollow Stem Auger Soil Borings / Well Installation**

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☒ GOGGLES: Spoggles required if winds exceed 15 mph. ☐ FACE SHIELD HEARING PROTECTION: (as needed). ☐ SAFETY SHOES: Steel or Composite Toe.	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: Fluorescent long-sleeve shirt or long-sleeve shirt and reflective safety vest.	☒ GLOVES: Cut-Resistant, and Nitrile. ☒**Error! Bookmark not defined.** OTHER: Insect Repellant, Sunscreen (as needed).

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Truck-Mounted Drilling Rig or Track Rig, Saw, Hand Tools, Photoionization Detector, Multi-Gas Meter (or equivalent), Interface Probe, 20 lb. Type ABC Fire Extinguisher, Traffic Cones/barrels, Caution Tape & Flags, "Work Area" Signs.

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing LMRAs

EXCLUSION ZONE (EZ): Maintain a Minimum Heavy Equipment Exclusion Zone around equipment and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, the tip zone of the equipment, the fall zone of the equipment, and the contents.

"SHOW ME YOUR HANDS"
Driller and helper should show that hands are clear from controls and moving parts

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Mobilization/demobilization and establish a work area.	**1a. See Mobilization/ Demobilization JSA GEN-015.**	1a. See Mobilization / Demobilization JSA GEN-015.
2. Raising the tower/derrick of the drilling rig.	**2a. CONTACT:** Overhead hazards.	2a. Prior to raising the tower/derrick, the area above the drilling rig will be inspected for overhead hazards (wires, tree limbs, piping, or other structures) that may be contacted by the rig's tower or drilling rods. 2a. The tower/derrick must not be raised beneath overhead power lines unless approved by the Roux PM. 2a. Maintain a minimum of 10' from all overhead structures. 2a. Do not move the rig while the tower/derrick is raised.
	2b. CONTACT: Amputation/crush points when raising the rig and the instability of the rig.	2b. Inspect the equipment prior to use and avoid any potential amputation points. 2b. Lower outriggers to ensure stability prior to raising the rig tower derrick. Keep feet and body out of the line of fire when lowering outriggers. 2b. Inspect the set-up location for uneven terrain. Level or avoid the area if needed. 2b. If the rig needs to be mounted, be sure to use three points of contact.
3. Advancement of augers for soil boring installation.	**3a. CONTACT:** Equipment imbalance during advancement of drill equipment.	3a. Drillers will advance the borehole with caution to avoid causing the rig to become imbalanced and/or tip. 3a. The blocking and leveling devices used to secure the rig will be inspected by drillers and Roux personnel regularly to see if shifting has occurred. **3a. Drillers will maintain the "Purple Zone" policy surrounding augers to ensure no personnel come into contact with augers while in use. Workers can spray paint a 3' semi-circle surrounding the augers to visually show that no personnel should enter the "Purple Zone" while drilling activities are being conducted.** 3a. In addition, personnel and equipment that are non-essential to the advancement of the borehole will be positioned away from the rig at a distance that is at least as far as the boom is high (minimum exclusion zone of 20 feet).
	3b. CONTACT: Flying/spraying debris.	3b. Wear all required PPE (especially hand, eye, and ear protection). 3b. Maintain minimum EZ distance (i.e., swing/tip radius of rig) when rig is in operation to avoid potential line of fire hazards from flying materials or debris.
	3c. CAUGHT: Limb/extremity amputation, abrasion, and crushing.	3c. Inspect the equipment prior to use for potential pinch points. 3c. Test all emergency shutdown devices prior to drilling. 3c. Inspect the drill head for worn surface or missing teeth; replace it if damaged or blunt. 3c. Inspect augers; do not use if the auger flight is damaged or bent.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
3. Advancement of augers for soil boring installation (Continued).	**3c. CAUGHT:** Limb/extremity amputation, abrasion, and crushing.	3c. Ensure all jewelry is removed, loose clothing is secured, and PPE is secured close to the body. 3c. All non-essential personnel should stay away from the immediate work area; position the body out of the line-of-fire of equipment, particularly when installing auger flights and steel override casings. 3c. Drillers and helpers will understand and use the "Show Me Your Hands" Policy. 3c. Spinning augers should have an exclusion zone of 20 feet when in operation.
	3d. FALL: Slip/trip/fall hazards.	3d. Inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions prior to mobilizing equipment. 3d. Do not climb over stored materials/equipment; walk around. Practice good housekeeping. 3d. Use established pathways and walk on stable, secure ground. 3d. Use three points of contact when mounting or dismounting the rig. 3d. Remove soil cuttings to avoid a tripping hazard from developing near augers.
	3e. EXPOSURE: Inhalation of contamination/vapors.	3e. Air monitoring using a calibrated photoionization detector (PID) and multi-gas meter to monitor the breathing zone of the work area. 3e. The Action Level for breathing zone air is five (5) parts per million (sustained) as detected by the PID. 3e. If a reading of >5ppm is recorded, the Roux field personnel must temporarily cease work, instruct all Site personnel to step away from the area of elevated readings, and inform the Roux PM of the condition. The Roux PM will then recommend additional appropriate precautions in accordance with the site-specific health and safety plan.
	3f. EXPOSURE: Noise and dust.	3f. Wet borehole area with sprayer to minimize dust. Stand upwind and keep your body positioned away from the rig. 3f. Wear hearing protection while the drill rig is operating or the noise levels exceed 85 dBA.
	3g. EXERTION: Installing well casings and lifting augers.	3g. Keep back straight and bend at the knees. 3g. Utilize team lifting for objects heavier than 40 lbs. 3g. Use a mechanical lifting device for odd-shaped objects.
4. Installation of well materials.	**4a. CONTACT:** Installing well materials while also pulling up augers.	4a. Potential contact with augers during the installation of well materials. 4a. Keep distance from augers and do not place any materials while augers are in motion.
	4b. CAUGHT: Possible pinch or crush hazard assembling PVC and sending down the borehole.	4b. Keep all body parts out of potential pinch points while placing PVC together and sending down borehole.
	4c. FALL: Slip/trip/fall hazards with hand tools and materials.	4c. See 3d.
	4d. EXPOSURE: Potential contamination, harmful vapors, dust, and/or noise.	4d. See 3e and 3f. 4d. Stand upwind to avoid exposure to dust generated from packing materials.
	4e. EXERTION: Lifting heavy bags of materials to backfill the borehole.	4e. See 3g.
5. Cleaning the auger flights	**5a. CONTACT:** Cuts/scrapes or puncture wounds from contacting the auger.	5a. Follow the "Show Me Your Hands" Procedure and make sure the auger is out of gear before contacting the auger with the tool or hand. 5a. Pull the cleaning tool across your body with the handle away from your body; do not push toward the auger. 5a. Do not clean more than ¾ turn around the auger at a time. 5a. Wear cut-resistant and nitrile gloves. 5a. Always use two hands to operate the cleaning tool. 5a. Inspect the tool before use and remove from service if the handle or metal is cracked/fatigued. 5a. Stand out of the line of fire.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
6. Decontaminate equipment.	**6a. EXPOSURE / CONTACT:** To contamination (e.g., contaminated groundwater, vapors).	6a. Wear chemical-resistant disposable gloves and safety glasses. 6a. Contain decontamination water so that it does not spill. 6a. Use an absorbent pad to clean spills, if necessary.
	6b. EXPOSURE: To chemicals in cleaning solution (including ammonia).	6b. See 3e. Wear all appropriate PPE and stand upwind of any exposed cleaning solutions.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

JOB SAFETY ANALYSIS	Ctrl. No. GEN-015	DATE: 05/28/2025	☐NEW ☒REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
GENERIC	**Site Recon**	**Mobilization/Demobilization**

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☐ GOGGLES ☐ FACE SHIELD ☒ HEARING PROTECTION (as needed) ☒ SAFETY SHOES: Steel Toe or composite toe	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: Fluorescent reflective vest of high-visibility clothing; long-sleeved shirt; long pants	☒ GLOVES: Cut-resistant Level II, nitrile ☐ OTHER

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Required Equipment: Varies

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing LRAs

EXCLUSION ZONE (EZ): Maintain a Minimum Heavy Equipment Exclusion Zone around equipment and loads while in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, the tip zone of the equipment, the fall zone of the equipment, and the contents.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Mobilize/demobilize and establish a work area	**1a. FALL:** Slip/trips/falls from obstructions, uneven terrain, weather conditions, heavy loads, and/or poor housekeeping.	1a. Use 3 points-of-contact/ensure secure footing when entering and exiting the vehicle. 1a. Inspect walking path for uneven terrain, steep hills, obstructions, and/or weather-related hazards (i.e., ice, snow, and puddles) prior to mobilizing equipment. Use established pathways. Walk on stable/secure ground. 1a. Do not climb over stored materials/equipment; walk around. Practice good housekeeping; organize and store equipment neatly in one area at its lowest potential energy. 1a. Wear boots with adequate treads. 1a. Delineate unsafe areas with traffic safety cones, caution tape, and/or flagging.
	1b. CONTACT: Personal injury and/or property damage caused by being struck by Site traffic or equipment used in Site activities.	1b. Observe and maintain the posted speed limits. 1b. When first arriving onsite, park vehicles in designated parking spaces and/or out of the way locations. Use parking brake on all vehicles and tire chocks on work trucks and trailers. 1b. Check in with Site Manager/Supervisor to ensure coordination with other Site activities and to discuss any special hazards. Ensure that short-service employees (SSE) are identified. 1b. Identify potential traffic sources. 1b. Wear PPE, including high visibility clothing or reflective vest, when around vehicles or operating equipment 1b. Use a spotter while moving work vehicles; plan to avoid backing whenever possible. 1b. Maintain a minimum exclusion zone when vehicles are in motion (i.e., greater than the swing/tip radius of the equipment). When backing up the truck rig with an attached trailer, use a second spotter if there is tight clearance simultaneously on multiple sides of the equipment or if turning angles limit driver-to-spotter visibility. 1b. Delineate work area with traffic cones, flags, caution tape, and/or other barriers. 1b. Position “Work Area” signs at Site entrances, if possible, or at either side of the work area. 1b. Position the largest vehicle to protect against oncoming traffic. 1b. Face traffic, maintain eye contact with oncoming vehicles, use a spotter, and establish a safe exit route.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
		1b. Observe potential overhead and ground surface features that may interfere with moving equipment. Clear the path of physical hazards prior to initiating mobilization.
	1c. CAUGHT: Personal injury from pinch points and being in the line of fire of the vehicle and/or equipment.	1c. Make sure the driver has engaged the parking brake and placed wheel chocks in a position to prevent movement. Be sure that the vehicle is parked in front/down gradient (positioned to block oncoming traffic) of the work area. 1c. Wear cut-resistant gloves (Kevlar or similar) when handling objects/tools or equipment, 1c. Keep body parts away from line-of-fire of equipment. 1c. Always carry tools by the handles and/or designated carrier. Ensure sharp-edged tools are sheathed/secure. 1c. Remove any loose jewelry. Avoid wearing loose clothing and/or ensure loose clothing is secure. 1c. Secure all items on the equipment, tighten up any items or features that have the potential to shift or break during mobilization.
	1d. OVEREXERTION: Muscle strains while lifting/carrying equipment.	1d. Use body positioning and lifting techniques that avoid muscle strain; keep back straight, lift with legs, turn with whole body, keep load close to body, and never reach with a load. 1d. Ensure that loads are balanced. Use assistance (mechanical or additional person) to carry equipment that is either unwieldy or over 50 lbs.
	1e. EXPOSURE: Personal injury from exposure to biological and environmental hazards.	1e. Inspect the area to avoid contact with biological hazards (i.e., poisonous plants, stinging insects, ticks, etc.). 1e. Wear long-sleeved clothes that can be treated with Permethrin, apply insect repellent (may contain DEET) to exposed skin, and inspect clothes and skin for ticks during and after work. 1e. Apply sunscreen (SPF 15+) if exposure to the sun for 30 minutes or more is expected.
	1f. EXPOSURE: Weather-related injuries.	1f. Watch for heat stress symptoms (muscle cramping, exhaustion, dizziness, nausea, rapid and shallow breathing). Take breaks in cool places and hydrate as needed. 1f. Watch for cold stress symptoms (severe shivering, slowing body movement, weakness, stumbling or inability to walk, collapse). Take breaks in warm areas as needed. 1f. Wear clothing appropriate for weather and temperature conditions (e.g., rain jackets, snow pants, multiple layers). 1f. If lightning is observed, wait 30 minutes in a sheltered location (car is acceptable) before resuming work.
	1g. EXPOSURE: Personal injury from noise hazards.	1g. Wear hearing protection if sound levels exceed 85 dBA (if you must raise your voice for normal conversation).

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-016	DATE: 05/28/2025	☐NEW ☒REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
GENERIC	**Construction – Concrete & Asphalt**	**Concrete Sidewalk Flag / Well Pad Replacement**

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☐ GOGGLES ☒ FACE SHIELD: (When Jackhammering) ☒ HEARING PROTECTION: (While Jackhammering or when the compressor is running) ☒ SAFETY SHOES: Steel or Composite toe	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: High visibility long-sleeved shirt/ Safety vest	☒ GLOVES: Cut Resistant (level II) and Nitrile ☒ OTHER: Dust Mask

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Required Equipment: Concrete Truck, Concrete Mixer, Jack Hammer, Air Saw or Gas-Powered Saw, Compressor, Hand Tools, Wheel Barrel, Multi-Gas Meter, Safety Cones, Caution Tape, 20-lb. Type ABC Fire Extinguisher, "Work Area" Signs, Pressurized Water Sprayer, Flush-Mounted Curb Boxes, GFCI for electric cords or equipment used outdoors

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing LMRAs

EXCLUSION ZONE (EZ): Maintain a Minimum Heavy Equipment Exclusion Zone around equipment and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, tip zone of the equipment, fall zone of the equipment and contents, distance that debris may travel during demolition activities, and/or footprint of a structure to be demolished.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Verify pre-clearance protocol and mobilize/demobilize.	**1a. CONTACT:** Property damage, personal injury, or underground utilities.	1a. Confirm that local utility companies were contacted prior to sidewalk flag / concrete pad replacement. Obtain One Call Tickets **1a. Walk the Site to evaluate utility markings, review maps, and complete the subsurface clearance form.**
	1b. CONTACT: With traffic (including any unintended movement of the work truck), contact/interference with other site activities.	1b. Identify potential traffic hazards. 1b. Use a spotter while moving work vehicles; plan ahead to avoid backing up when unnecessary. Use additional spotters if necessary. 1b. Ensure that the truck has wheel chocks in place when parked and the compressor is chocked if detached from the truck. 1b. Delineate work area with cones, flags, caution tape, and/or other barriers. Construct a pedestrian walkway, if needed. Use a truck to barricade if possible. 1b. Maintain a minimum exclusion zone based on equipment. 1b. Position "Men at Work" signs at site entrances or on either side of the exclusion zone. 1b. Face traffic, maintain eye contact with oncoming vehicles, use a spotter, and establish a safe exit route; wear bright colored clothing/safety vest.
2. Concrete saw cutting and jackhammering.	**2a. CONTACT:** Flying debris and hoses.	2a. Wear PPE (especially hand, eye, ear, and face shield). 2a. Use anti-whip devices on compressor hoses. 2a. Maintain a minimum exclusion zone based on equipment. 2a. If third-party vehicles are close by, ask third parties to move vehicles or construct a shield (e.g., poly sheeting or plywood) to protect cars.
	2b. EXPOSURE: Inhalation/exposure to hazardous vapors and/or concrete dust, and noise.	2b. Monitor the breathing zone with a calibrated PID and multi-gas meter. If vapors sustain levels > 5 ppm, the Roux field personnel must temporarily cease work and instruct all Site personnel to step away from the area of elevated readings. 2b. Wet the concrete while using the saw to minimize dust. If possible, use Vactron as dust suppression in freezing weather conditions. 2b. Stand upwind and keep your body behind the saw. 2b. No open flames/heat sources. 2b. Wear hearing protection when a saw, jackhammer, or air compressor is in operation.
	2c. EXERTION: Poor body positioning and/or handling equipment and materials.	2c. Keep back straight, lift with legs, keep the load close to the body, and never reach with a load. Ensure that loads are balanced to reduce the potential for muscle strain. Use the buddy system for maneuvering loads greater than 40 lbs. or a mechanical lifting device.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
2. Concrete saw cutting and jackhammering (Continued).	**2d. FALL:** Tripping/falling due to uneven terrain, weather conditions, and materials /equipment stored at the Site, broken up concrete.	2d. Inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions prior to mobilizing equipment. 2d. Equipment and tools will be staged in a designated, convenient, stable, and orderly manner. Store at the lowest point of potential energy and out of the walkway and immediate work area. 2d. Ensure power cords connected to GFCI and water lines are grouped when used within the work area. 2d. Concrete flag and flush-mounted curb box will be finished flush to grade so as not to present a slip/trip hazard. 2d. Place concrete chunks into an appropriate disposal container (drum, roll-off, dump truck, etc.).
	2e. CAUGHT: Pinch points associated with the equipment and vacuum hose.	2e. Always wear cut-resistant gloves when making connections and using hand tools, as well as when handling cutting tools. 2e. Inspect the equipment prior to use for potential pinch points. 2e. Test all emergency shutdown devices prior to performing the task. 2e. Inspect saw blade for worn surface or missing teeth; switch blade if damaged, warped, or blunt. 2e. Ensure all jewelry is removed, loose clothing is secured, and PPE is secured close to the body. 2e. All non-essential personnel should stay away from the immediate work area; position the body out of the line of fire of equipment. Maintain the established exclusion zone distance. 2e. Use the **"Show Me Your Hands"** Policy.
3. Mixing/Pouring concrete and installing a manhole.	**3a. CONTACT:** Burn from handling/pouring concrete.	3a. Wear required PPE (including Nitrile gloves, long-sleeved shirts, safety glasses) when handling dry/wet concrete and forming concrete flags. 3a. Inspect all transfer equipment (Concrete Truck, wheel barrel, etc.) prior to pouring concrete. 3a. All non-essential personnel should stay away from the immediate work area; position the body out of line-of-fire of equipment and concrete flow. Maintain the established exclusion zone distance.
	3b. EXERTION: Poor body positioning and use of handling equipment and materials.	3b. See 2c.
	3c. FALL: Tripping/falling due to uneven terrain, weather conditions, and materials/equipment stored at the site.	3c. See 2d.
	3d. EXPOSURE: Concrete silicates pose dermal and inhalation hazards.	3d. Wear nitrile (inner) gloves and a long-sleeved shirt to mitigate dermal contact. 3d. A disposable dust mask/respiratory protection may be worn by personnel mixing concrete.
4. Move the drum to the designated staging area (if used).	**4a. Refer to Drum Handling JSA for Potential Hazards.**	4a. **Refer to Drum Handling JSA for Critical Actions.**
5. Decontaminate equipment	**5a. EXPOSURE:** Wet concrete and dust.	5a. Wear chemical-resistant disposable gloves and safety glasses. 5a. Use an absorbent pad to clean spills.
	5b. EXPOSURE: Chemicals in cleaning solution, including ammonia.	5b. See 3a.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-017	DATE: 05/28/2025	☐NEW ☒REVISED	PAGE 1 of 2

JSA TYPE CATEGORY:	WORK TYPE:	WORK ACTIVITY (Description):
GENERIC	**Drilling**	**Monitoring and Recovery Well Development**

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☐ GOGGLES ☐ FACE SHIELD ☒ HEARING PROTECTION (as needed) ☒ SAFETY SHOES: Composite-toe or steel-toe boots	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: Fluorescent reflective vest or high visibility clothing	☒ GLOVES: Cut-resistant level II and Nitrile ☒ OTHER: Insect repellent, sunscreen (as needed)

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Required Equipment as needed: Truck Rig or support truck, Trailer, Traffic Safety cones and flags, Caution Tape, Interface Probe, Power Source, Submersible Pump, Surge Block/Plunger, 20 lb. Type ABC Fire Extinguisher, Holding Tanks and/or Buckets, Absorbent Pads, 5-gas meter, Tools as needed: Socket and Pipe Wrench, Screw Driver, Pry Bar, Ratchet, Vault Key, Clamp or Vice Grip.

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing LMRAs

EXCLUSION ZONE (EZ): Maintain a Minimum Heavy Equipment Exclusion Zone around equipment and loads while in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, the tip zone of the equipment, the fall zone of the equipment, and the contents.

"SHOW ME YOUR HANDS"
The driller and helper should show that their hands are clear of controls and moving parts.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Mobilization / Demobilization (**Review Mobilization and Demobilization JSA - GEN-015**)	**1a. CONTACT:** Equipment/property damage.	1a. The truck rig's tower/derrick will be lowered and secured prior to mobilization. 1a. Set up the work area/position equipment in a manner that eliminates or reduces the need for backing of trucks and trailers. 1a. All non-essential personnel should **maintain an exclusion zone greater than the swing/tip radius of the equipment.** 1a. Beep horn twice before backing up. 1a. When backing up with an attached trailer, use a spotter Position if able to avoid backing up and pull through.
	1b. FALL: Slip/trip/fall hazards.	1b Inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions prior to mobilizing equipment. 1b. Do not climb over stored materials/equipment; walk around. Store equipment at the lowest potential energy.
2. Open/close well.	**2a. EXERTION:** Muscle strain (some wells have large vault covers).	2a. Keep back straight, lift with legs, keep the load close to the body, and never reach with a load. Ensure that loads are balanced to reduce the potential for muscle strain. Use the buddy system or mechanical means when lifting objects heavier than 50 lbs or when the shape makes the object difficult to lift.
	2b. CAUGHT: Pinch points are associated with removing/replacing manholes and working with hand tools.	2b. Wear cut-resistant gloves when working with well vault/cover and hand tools. Do not put fingers under the well vault/cover. 2b. Use ratchet and pry bar for the well cover and inspect before use.
	2c. EXPOSURE: Potentially hazardous vapors.	2c. No open flames/heat sources. 2c. Allow the well to vent after opening it and before starting development activities to minimize exposure to vapors. Air monitoring must be performed prior to set up and during the well development activities. Work on the upwind side of the well.
	2d. CONTACT: Traffic.	2d. Wear required PPE, including high visibility clothing or reflective vest. 2d. Delineate work area with safety cones and/or other barriers. Position the vehicle to protect against oncoming traffic. 2d. Face traffic, maintain eye contact with oncoming vehicles, and establish a safe exit route.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – Electricity, Pressure, compression, tension, torque.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
3. Develop well (mechanical surging).	**3a. CAUGHT:** Cut hazards and finger pinch points.	3a See 2b. 3a. Use required PPE, including cut-resistant level II gloves, when handling development equipment. Identify finger/hand pinch points. Keep hands away from active surge equipment. 3a. All non-essential personnel should **maintain an exclusion zone greater than the swing/tip radius of the equipment.**
	3b. CONTACT/EXPOSURE: Contamination (e.g., SPH, contaminated groundwater, vapors).	3b. See 2c. 3b. Wear Nitrile gloves and safety glasses. Insert and remove the surge block/plunger and line/cable slowly to avoid splashing at the surface. 3b. Use an absorbent pad to clean any spills.
	3c. EXERTION: Muscle strain from lifting equipment.	3c. See 2a. 3c. Use mechanical device to insert and remove surge block/plunger if greater than 40 lb.
	3d. CONTACT: Injury while handling wench line/cable, or with active surging equipment.	3d. If using a drill rig, inspect all wench lines/cables for any kinks or fraying prior to use. Replace any damaged lines/cables. Review the **Drill Rig checklist prior to development activities**. 3d. See 3a.
4. Purging well (pumping water to holding tanks/drums/buckets).	**4a. CAUGHT:** Pinch points are associated with connecting the hose to the tank. Pinch points are associated with handling the pump and hoses.	4a. See 3a. 4a. Ensure that fingers are not placed near the coupling when attaching and securing the hose(s). Do not place fingers under the pump/hoses. Wear cut-resistant gloves when handling pump/hose(s). 4a. Keep hands clear of any line of fire.
	4b. FALL: Using a side-mounted ladder when attaching a hose to the tank. Slip, trip, or fall from lines/hoses	4b. Inspect ladder steps to make sure steps are not bent/damaged and free of debris/fluid. 4b. Use three points of contact always when using a ladder. 4b. Use a hoist or other mechanical means to secure and move hoses. 4b. Utilize anti-whip cords and secure couplings on all pressurized hoses. Keep hoses and lines coiled and organized out of designated walking paths around the work zone.
	4c. CONTACT: Contamination (e.g., SPH, contaminated groundwater).	4c. Secure water hose to holding tanks/drums/buckets with clamp, vice grip, or similar tool. 4c. Do not overfill tanks, and purge/transfer liquids in such a manner that they do not splash. (See 3b). 4c. Dispose of used materials/PPE in the designated impacted PPE container.
	4d. EXERTION: Muscle strain from lifting/carrying equipment.	4d. See 2a.
	4e. FALL: Spilled purge water.	4e. Clean up any spills using absorbent pads or spill kits.
5. Decontaminate equipment	**5a. CONTACT/EXPOSURE:** Contamination (e.g., SPH, contaminated groundwater, vapors).	5a. See 3b.
	5b. EXPOSURE/CONTACT: Chemicals in the cleaning solution	5b. Decontaminate equipment in a well-ventilated area. Wear nitrile gloves to avoid skin contact with cleaning solutions.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – Electricity, Pressure, compression, tension, torque.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-019	DATE: 05/28/2025	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
GENERIC	**Site Reconnaissance**	**Site Walk and Inspection**

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES	☐ GOGGLES ☐ FACE SHIELD ☒ HEARING PROTECTION: earplugs/muffs as necessary ☒ SAFETY SHOES: Steel or composite toed	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: High-visibility vest or high-vis outerwear	☒ GLOVES: /cut-resistant (level II)/chemical resistant ☒ OTHER: Tyvek and rubber boots as necessary, dust mask as necessary

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Required Equipment: Site map, emergency contact list, documentation of urgent care/hospital routes, and/or guide familiar with Site, operating cell phone or walkie-talkie if Site allows, and bug spray.

Commitment to Safety – All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing LMRAs

EXCLUSION ZONE (EZ): Maintain a Minimum Heavy Equipment Exclusion Zone around equipment and loads while in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, the tip zone of the equipment, the fall zone of the equipment, and the contents.

SITE SECURITY: Before site inspection, verify the appropriate method to address Site Security concerns related to potential criminal activity, homeless population, and/or isolation concerns. Work with the Project Principal and/or Project Manager to address appropriately.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Check in with the Site contact.	**1a. CONTACT/EXPOSURE/FALL:** Personal injury caused by a lack of awareness of site-specific hazards.	1a. Inquire about hazards and other activities taking place at the Site. 1a. Inform Site contact of work scope, timeline, and location(s). 1a. Discuss emergency evacuation procedures and muster points with the Site contact.
2. Traversing the Site	**2a. CONTACT:** Property damage and personal injury caused by obstructions/vehicles or unauthorized personnel at remote Sites.	2a. All equipment must be stowed and secured prior to moving. 2a. Maintain speed limit as posted on-site. 2a. When possible, drive on established roadways. 2a. Yield to all pedestrians. 2a. Use pull-through spots or back into parking spots. 2a. Don high-visibility clothing/safety vest. If working at a remote Site, add orange accessories during hunting season.
	2b. FALL: Uneven terrain and weather conditions. Overgrown shrubs and vines. Equipment in the work zone.	2b. Inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions prior to mobilizing equipment. 2b. Use established pathways and walk on stable, secure ground when possible. 2b. Communicate traversing hazards with others.
	2c. OVEREXERTION: Muscle strain while carrying equipment.	2c. When carrying equipment to/from the work area, use proper lifting techniques; keep back straight, lift with legs, keep the load close to the body, never reach with a load. Ensure that loads are balanced to reduce the potential for muscle strain. Use the buddy system or mechanical means to maneuver items heavier than 40 lbs. If necessary, make multiple trips to carry equipment.
	2d. EXPOSURE: Biological hazards – ticks, bees/wasps, poison ivy, insects; (Ticks are most active whenever the temperature is above freezing, typically from March to November.)	2d. Inspect the area to avoid contact with biological hazards. 2d. Ticks: • Treat outer clothing, including pants, shirts, socks, boots, and hats, the evening before with Permethrin (allowing at least two hours before use). • Apply DEET or equivalent to exposed skin before travelling to the Site and reapply after two hours. • Wear light colored clothing and visually check for ticks during and after work. 2d. Bees: • Use bee spray as appropriate to deter/eliminate bees. • Protect exposed skin with insect repellent.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
	2e. EXPOSURE: Heat Stress & Cold Stress. Personal injury from working in inclement weather conditions.	2d. Poison Ivy: • Identify areas of poison ivy and spray with weed killer. Don Tyvek and rubber boots while traversing poison ivy areas. • If skin comes into contact with poison ivy, wash the skin thoroughly with soap and water. 2e. Wear sunscreen with SPF 15 or greater on exposed skin whenever 30 minutes or more of sun exposure is expected. 2e. Watch for heat stress symptoms (muscle cramping, exhaustion, dizziness, rapid and shallow breathing). Take breaks as needed. 2e. Watch for cold stress symptoms (severe shivering, slowing body movement, weakness, stumbling or inability to walk, collapse). Take breaks as needed. 2e. Wear appropriate rain gear as needed. 2e. Take frequent breaks if tired, wet, or cold/hot. Drink water. 2e. If lightning is observed, wait 30 minutes after the last thunder boom/lightning bolt in a sheltered location (car acceptable) before starting work again.
3. Walking near heavy equipment and machinery.	**3a. CONTACT:** Personal injury from Site and roadway traffic. Personal injury from flying debris **3b. OVEREXERTION:** Personal injury from lifting/moving/rotating equipment. **3c. EXPOSURE:** Hearing damage from noise-generating equipment/processes. Inhalation/exposure to hazardous vapors and or dust. **3d. EXPOSURE:** Working in a remote area.	3a. See 2a. 3a. Maintain an exclusion zone of at least 10 feet from all engaged equipment. Increase distance to include swing tip radius. 3a. Keep body parts out of the line-of-fire of pinch points. 3a. Wear appropriate PPE always. 3b. See 2c. 3c. Wear hearing protection if >85 dBA. (i.e., noise levels which require you to raise your voice to communicate) 3c. Always wear cut-resistant gloves when handling any tools or equipment. 3c. Always wear appropriate PPE based on the chemicals present. 3d. Use the "buddy system" whenever possible. If working alone, contact PM upon arrival/departure and during work activities prior to commencing work if applicable. 3d. Always carry a communication device (i.e., cell phone, walkie-talkie) or directional (i.e., map, compass, etc.) when traversing remote areas. 3d. If available, follow Lone Worker Protocol/Procedure.
4. Working in adverse weather conditions.	**4a. EXPOSURE:** Heat Stress & Cold Stress. Personal injury from working in inclement weather conditions.	4a. Watch for heat stress symptoms (muscle cramping, exhaustion, dizziness, rapid and shallow breathing). Take breaks as needed. 4a. Watch for cold stress symptoms (severe shivering, slowing body movement, weakness, stumbling or inability to walk, collapse). Take breaks as needed. 4a. Wear appropriate rain gear as needed. 4a. Take frequent breaks if tired, wet, or cold/hot. Drink water. 4a. If lightning is observed, wait 30 minutes after the last thunder boom/lightning bolt in a sheltered location (car acceptable) before starting work again.
5. Departing Site.	**5a. EXPOSURE:** Exposure to unnecessary hazards should prompt personnel to believe Roux is on-site during an emergency and conduct a search.	5a. Sign out or notify the Site contact and Roux Project Manager of your departure.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.

[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.

[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-020	DATE: 05/29/2025	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY:	WORK TYPE:	WORK ACTIVITY (Description):
GENERIC	**Gauging & Sampling**	**Soil Sampling**

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST ☒ HARD HAT ☐ LIFELINE / BODY HARNESS ☒ SAFETY GLASSES ☒ FLAME RESISTANT CLOTHING (as needed)	☐ GOGGLES ☐ FACE SHIELD: ☒ HEARING PROTECTION: (as needed) ☒ SAFETY SHOES: Composite-toe or steel-toe boots	☐ AIR PURIFYING RESPIRATOR ☐ SUPPLIED RESPIRATOR ☒ PPE CLOTHING: Fluorescent reflective vest or high visibility clothing	☒ GLOVES: , Nitrile and cut resistant level II ☒ OTHER: Insect repellent, sunscreen (as needed)

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Recommended Equipment: traffic safety cones, caution tape, trowel

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing LMRAs.

EXCLUSION ZONE (EZ): Maintain a Minimum Heavy Equipment Exclusion Zone around equipment and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, the tip zone of the equipment, the fall zone of the equipment, and the contents.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Secure location	**1a. CONTACT:** Personnel and vehicular traffic may enter the work area.	1a. If in an area with foot or vehicle traffic, delineate the work area with traffic cones and/or caution tape to prevent exposure to traffic and inform others of work activity. 1a. Wear a reflective vest and/or high visibility clothing. 1a. Face the direction of any vehicular traffic. Position the vehicle to protect the worker from traffic. 1a. Communicate work activity with adjacent work areas.
	1b. FALL: Tripping/falling due to uneven terrain or entry/exit from excavations.	1b. Inspect pathways and work area for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions. 1b. Use established pathways and walk on stable, secure ground. 1b. Stage equipment and tools in a convenient, stable, and orderly manner. Store equipment at the lowest potential energy. 1b. Roux employees should stay 6 feet from in-progress excavations and trenches. Should entry to an excavation be required (when stabilization is complete), ladders must be employed for steep embankments, excavations, pits, and trenches.
	1c. EXPOSURE: Exposure to sun and excessive heat, possibly causing sunburn, heat exhaustion, or heat stroke. Exposure to cold temperatures may cause cold stress. Skin burn as a result of fire, if applicable. Exposure to explosive vapors due to tank farm operations. Exposure to airborne dust due to high wind speeds. Biological hazards - ticks, bees/wasps, poison ivy, thorns, insects, etc.	1c. Wear sunscreen with an SPF 15 or greater whenever 30 minutes or more of exposure is expected. 1c. Use a tent to shade the work area from direct sunlight, particularly when warm temperatures are expected. 1c. Be aware of the location of all Site personnel. 1c. Watch for heat stress symptoms (muscle cramping, exhaustion, dizziness, rapid and shallow breathing). 1c. Watch for cold stress symptoms (severe shivering, slowing of body movement, weakness, stumbling or inability to walk, collapse). 1c. Take breaks for rest and water as necessary. Move to an area that is well shaded or a climate-controlled area (i.e., car, site trailer, etc.). 1c. No open flames/heat sources. 1c. Conduct air monitoring and ensure that harmful vapor concentrations are within the levels detailed in the Site Specific HASP. Follow the procedures detailed in HASP for exceedances. 1c. Flame retardant clothing must be worn when specified by Site policy. 1c. Cell phones should be disabled when specified by Site policy. 1c. Pre-treat field clothing with Permethrin prior to site visit to kill ticks and insects. 1c. Wear long-sleeved shirts and tuck in (or tape) pant legs into socks or boots to prevent ticks from reaching skin. 1c. Spray insect repellent containing DEET or equivalent on exposed skin when working in overgrown areas of the Site. 1c. Inspect the area to avoid contact with biological hazards. 1c. Wear cut-resistant gloves when handling material, equipment, or branches, shrubs, etc. that may lie within the walking path. 1c. Wear spoggles if the average wind speeds are above 15 mph. 1c. Personnel shall examine themselves and their co-workers' outer clothing for ticks periodically when on-site. 1c. If skin comes in contact with poison ivy, wash skin thoroughly with soap and water. If rash persists after washing, immediately notify your supervisor, the OM, and OHSM for possible consultation with a physician at an approved Occupational Health Clinic.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
2. Collect Soil Sample	**2a. CONTACT:** Personal injury from pinch points, cuts, and abrasions from sampling equipment, tools, and material within the soil sample. Personal injury from contact with moving equipment while sampling. Personal injury from contact with glass sample jars.	2a. Wear cut-resistant (i.e., Kevlar) gloves under chemical-resistant (nitrile) disposable gloves when handling soil samples and sampling jars. 2a. Where possible, use a trowel or equivalent tool to avoid contact with soil. 2a. If sampling from a bucket of heavy equipment, ensure all equipment is off and the operator utilizes the "show me your hands" policy. 2a. See 1a.
	2b. EXPOSURE: Exposure to contamination (impacted soil) and/or lab preservatives.	2b. Wear chemical-resistant (nitrile) disposable gloves over cut-resistant gloves to protect hands when handling samples; use containment material or plastic sheeting to protect surrounding areas. 2b. Wear safety glasses to protect eyes from dust or air-borne contaminants that may result from disturbing the soil. 2b. Where possible, remain upgradient from the sample location if collecting soil samples from stockpile, drill rig, etc., to avoid breathing contaminant vapors, if they are present. 2b. When collecting a soil sample from a hand auger, put a large zip lock bag over the entire auger to prevent soil from spilling onto the ground. 2b. Open sample jars slowly and fill carefully to avoid contact with preservatives.
	2c. EXERTION: Exertion due to repetitive motion and ergonomics.	2c. Utilize a table or raised surface for soil sampling if multiple soil samples are going to be taken to minimize repetitive bending motion.
3. Decontaminate equipment	**3a. EXPOSURE/CONTACT:** Contamination (e.g., Separate Phase Hydrocarbons (SPH), contaminated vapors, and/or soil). **3b. EXPOSURE:** Chemicals in the cleaning solution include ammonia.	3a. Wear chemical-resistant (nitrile) disposable gloves and safety glasses. 3a. Use an absorbent pad to clean spills. 3a. Properly dispose of used materials/PPE in the provided drums in the designated drum storage area. 3a. Remain upwind of the sample and avoid breathing contaminant vapors, if they are present. 3b. Wear chemical-resistant (nitrile) disposable gloves and safety glasses. 3b. Work on the upwind side of the decontamination area. 3b. Use an absorbent pad to clean spills. 3b. Properly dispose of used materials/PPE in the provided drums in the designated drum storage area. Ensure that all drums are properly labeled and secured.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-029	DATE: 05/29/2025	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
GENERIC	**Preclearing/Sampling**	**Hand Augering**

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST	☐ GOGGLES	☐ AIR PURIFYING RESPIRATOR	☒ GLOVES: Cut Resistant level II / Nitrile / Chemical resistant
☒ HARD HAT	☐ FACE SHIELD	☐ SUPPLIED RESPIRATOR	☐ OTHER
☐ LIFELINE / BODY HARNESS	☐ HEARING PROTECTION	☒ PPE CLOTHING: Long-sleeved high-visibility clothing	
SAFETY GLASSES	☒ SAFETY SHOES: Steel or composite-toed boots		

REQUIRED AND / OR RECOMMENDED EQUIPMENT

Hand Auger Tools (buckets, rods), 5-gallon buckets, hand tools (hammer, etc.)

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing LMRAs.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Drive/walk to hand clearing/hand augering location	**1a. CONTACT:** Property damage and personal injury caused by obstructions/vehicles	1a. Maintain speed limit on-site. 1a. All equipment must be stowed and secured prior to moving. 1a. Drive on established roadways. 1a. Do not back up the vehicle without a spotter where visibility is limited; use pull-through spots or back into parking spots; use an audible signal (horn/back-up alarm) when backing up vehicles.
	1b. FALL: Personal injury from tripping/falling due to uneven terrain, weather conditions, and materials/equipment stored at portions of the Site	1b. Inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions prior to mobilizing equipment. 1b. Do not climb over stored materials/equipment; walk around. Use established pathways and walk on stable, secure ground. 1b. Use the established ramp when descending into/ascending from impoundment areas. 1b. Keep tools and equipment in a designated area. When not in use, tools and equipment must be returned to their proper storage location. Keep the work area clear of obstructions.
	1c. EXERTION: Muscle strain/exhaustion while carrying equipment (i.e., hand auger, post-hole digger, shovel, pry bar)	1c. When carrying equipment to/from the work area, use proper lifting techniques; keep back straight, lift with legs, keep the load close to the body, never reach with a load. Ensure that loads are balanced to reduce the potential for muscle strain. Use mechanical assistance or make multiple trips to carry equipment.
	1d. EXPOSURE: Exposure to the sun, possibly causing sunburn. Biological hazards - bees/wasps, poison oak, thorns, insects, etc.	1d. Wear sunscreen with an SPF of at least 15 whenever 30 minutes or more of exposure is expected. 1d. Inspect the area to avoid contact with biological hazards. 1d. Wear cut-resistant gloves when handling material, debris, branches, shrubs, etc. that may lie within the walking path. 1d. Avoid any areas on-site that have poison oak.
Assess [1]JOB STEPS	**Analyze [2]POTENTIAL HAZARDS**	**Act [3]CRITICAL ACTIONS**
2. Secure location	**2a. CONTACT:** Personnel and vehicular traffic may enter the work area.	2a. Delineate the work area with traffic cones and/or caution tape to prevent exposure to traffic and inform others of work activity. 2a. Wear a reflective vest and/or fluorescent clothing. 2a. Face the direction of vehicular traffic. Position the vehicle to protect the worker from traffic. 2a. Communicate work activity with adjacent work areas.
	2b. FALL: Tripping/falling due to uneven terrain, and materials /equipment stored within the work area	2b. Inspect walking path for uneven terrain, weather-related hazards (i.e., ice, puddles, snow, etc.), and obstructions prior to mobilizing equipment to the impoundments. 2b. Equipment and tools will be staged in a convenient, stable, and orderly manner. 2b. Equipment and tools will be stored at the lowest point of potential energy and out of the walkway and immediate work area (i.e., tools should not be propped against walls or nearby equipment or vehicles). 2b. Equipment and tools that are not anticipated to be used will be returned to an appropriate storage area that is out of the immediate work area.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift." Avoid general statements such as, "be careful."

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
3. Verify pre-clearance protocol; review completed Subsurface Utility Checklist and utility verification site walkthrough.	**3a. ENERGY SOURCE:** Underground utility damage; property damage; personal injury	3a. Confirm that "Call Before You Dig"/811 and local utility companies were contacted prior to hand augering. 3a. Walk the Site to evaluate utility markings and review maps.
4. Augering/advancing borehole	**4a. EXPOSURE:** Contaminated soil/water/vapor	4a. Monitor the breathing zone with a PID when VOCs are a concern. If vapors exceed site-specific action levels, upgrade PPE as per the HASP. 4a. Wear chemical-resistant disposable gloves and safety glasses when handling impacted materials. 4a. Place excavated soil on plastic sheeting and store soil waste in a designated area. 4a. Work on the upwind side of the boring.
	4b. EXERTION: Muscle strain from lifting, bending, repetitive motion.	4b. Body positioning and rotating with the auger to reduce strain. Do not twist back.
	4c. CAUGHT: Personal injury as a result of jewelry/loose clothing caught on equipment, well covers, machinery, hand auger, pry bar, etc.	4c. No form of jewelry should be worn while on-site. 4c. Clothing must be appropriately sized so that it is not loose-fitting.
	4d. CONTACT/CAUGHT: Pinch points, abrasions	4d. Keep head and upper body clear when lifting hand auger, pry bar/post-hole digger. Ensure not to be overly aggressive when using the pry bar. 4d. Ensure all jewelry is removed, loose clothing is secured, and PPE is secured close to the body.
5. Lithologic observation and soil sampling	**5a. EXPOSURE:** Contact with contamination (impacted soil and/or lab preservatives)	5a. Wear chemical-resistant disposable gloves to protect hands when handling samples; wear safety glasses when on site and/ or goggles when handling any preservatives; use containment material or plastic sheeting to protect surrounding areas. 5a. When collecting a soil sample from a hand auger, put a large zip lock bag over the entire auger to prevent the spillage of soil onto the ground. 5a. Open sample jars slowly and fill them carefully to avoid contact with preservatives.
6. Decontaminate equipment	**6a. EXPOSURE:** Contact with contamination (impacted soil and/or lab preservatives, decontamination solution)	6a. Wear chemical-resistant disposable gloves and safety glasses. 6a. Use an absorbent pad to clean spills. 6a. Properly dispose of used materials/PPE trash bags. 6a. Refer to the SDS for the decontamination solution for proper handling.
	6b. CONTACT/CAUGHT: pinch points and cuts/abrasions	6b. Keep fingers/hands out of pinch points when disassembling the hand auger during decontamination.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

JOB SAFETY ANALYSIS	Ctrl. No. GEN-032	DATE: 05/30/2025	☐ NEW ☒ REVISED	PAGE 1 of 2

JSA TYPE CATEGORY	WORK TYPE	WORK ACTIVITY (Description)
Generic	**Construction**	**Spotting Third-Party Traffic**

REQUIRED AND / OR RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT

☐ LIFE VEST	☐ GOGGLES	☐ Particulate Respirator	☒ GLOVES: Cut-resistant Level II
☒ HARD HAT	☐ FACE SHIELD	☐ SUPPLIED RESPIRATOR	☐ OTHER:
☐ LIFELINE / BODY HARNESS	☐ HEARING PROTECTION	☒ PPE CLOTHING: Fluorescent reflective clothing	
☒ SAFETY GLASSES	☒ SAFETY SHOES: Steel-/Composite-toe boots		

REQUIRED EQUIPMENT

Traffic cones/ barrels, Handheld stop/slow paddles (1 per spotter), two-way radios as needed

COMMITMENT TO SAFETY- All personnel onsite will actively participate in hazard recognition and mitigation throughout the day by verbalizing LMRAs

EXCLUSION ZONE (EZ): Maintain a Minimum Heavy Equipment Exclusion Zone around equipment, active operations (e.g., excavation, truck loading, etc.), and loads while it is in motion. The HEEZ must be greater than the swing zone of any moving part of the equipment, tip zone of the equipment, fall zone of the equipment and contents, distance that debris may travel during demolition activities, and/or footprint of a structure to be demolished. The HEEZ should not be compromised in any way by third-party traffic.

Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
1. Prepare for heavy equipment operations and/or job activities that require traffic stoppage.	**1a. CONTACT:** Third-party traffic in and/or adjacent to the work area may create contact hazards with machinery and site personnel.	1a. Cordon off the work area with safety barrels/cones and a rigid barrier (snow fence, traffic bar, etc.). Ensure that only necessary personnel are in the work area. Spotter and equipment operator shall enforce the **EZ**. The operator will not operate but shall remain in hands-off mode while personnel are within the exclusion zone. • Spotters must agree on communication via voice and hand signals before the activity begins. • Spotters must be visible and maintain contact with other spotters. • If contact is lost with either spotter, work operations should stop until communication has been re-established. • Spotters should never have additional duties while they are spotting. 1a. Spotters must analyze traffic patterns adjacent to the site to assess which traffic direction will need to be redirected and what issues must be resolved before spotting traffic. 1a. The "Traffic Control Point" is a specific location where the spotter is positioned to direct traffic. 1a. **Spotters should select an appropriate Traffic Control Point where visibility, directions, and personal safety will be maximized.**
	1b. Fall : Slip/Trip/Fall	1b. Ensure that the Traffic Control Point is flat, level, and clear of any obstructions or debris before beginning spotting operations.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards; Energy Source – electricity, pressure, compression/tension.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".


Assess [1]JOB STEPS	Analyze [2]POTENTIAL HAZARDS	Act [3]CRITICAL ACTIONS
2. Spotting third-party traffic during site operations.	**2a. CONTACT:** Machine or load contact with third-party traffic.	2a. Discuss the specifics of the work, limits of the assigned work area, and the machine's Exclusion Zone. Maintain the Exclusion Zone while spotting third-party traffic. 2a. **Spotters and equipment operators shall have visual/ verbal contact or 2-way radios/cellular devices on their persons** to ensure audible communication in the event any changes or new hazards may arise. 2a. Spotters must make eye contact with the machine operations and third-party traffic, or all movement ceases until visual contact can be reestablished. 2a. Spotter shall keep an eye out for any traffic issues the operator may not see and communicate with other work crews and spotters accordingly. 2a. If the spotter needs to take a break, he must find a replacement before leaving or stop operations. **Operations that may contact third-party traffic shall not be performed without a spotter under any circumstances.** 2a. Wear fluorescent clothing/safety vest. **Handheld stop/ slow paddles (1 per spotter) are required for spotting third-party traffic.** 2a. Establish traffic control by performing all signals/movements with precision and ensuring drivers obey signals. • Break traffic at natural gaps whenever possible to direct opposite sides of traffic • Maintain consistency in the time you allow each direction of traffic to travel. Prioritize major routes over secondary routes. • If breaks do not occur, allow traffic to accumulate on opposite sides of the road before directing it to move. • Allow right turns whenever they do not interfere with traffic and pedestrians. • Make sure opposite lanes are stopped before allowing left turns to be made. 2a. **Do not multitask. Only perform Spotting.**
	2b. FALL: Slip/Trip/Fall	2b. Look where you are walking to identify and avoid slip/trip/fall hazards. Avoid icy and/or wet surfaces. Remove obstacles if possible. 2b. Use designated walkways during spotting whenever possible. 2b. **Do not walk backwards. Always face the direction towards which you are walking.**
	2c. CAUGHT: Caught between machinery and nearby objects.	2c. **Maintain Exclusion Zone.** Do not stand between large, loose, or fixed objects or structures and the machinery while it is in motion. Keep in sight of the operator at all times while being aware of surrounding structures.
	2d. EXPOSURE: Inhalation of exhaust from machinery.	2d. The spotter will position themself upwind of the working machinery, when possible. Spotter will also inform others working within the vicinity of the EZ of proper positioning, if applicable.

[1] Each Job or Operation consists of a set of tasks / steps. Be sure to list all the steps needed to perform job.
[2] A hazard is a potential danger. Break hazards into six types: Contact - victim is struck by or strikes an object; Caught - victim is caught on, caught in or caught between objects; Fall - victim falls to ground or lower level (includes slips and trips); Exertion - excessive strain or stress / ergonomics / lifting techniques; Exposure - inhalation/skin hazards.
[3] Using the first two columns as a guide, decide what actions or procedures are necessary to eliminate or minimize the risk. List the recommended safe operating procedures. Say exactly what needs to be done - such as "use two persons to lift". Avoid general statements such as, "be careful".

APPENDIX B

Safety Data Sheets (SDSs) for Chemicals Used



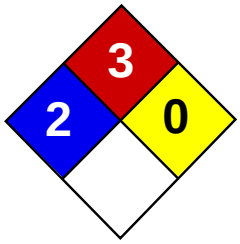



Material Safety Data Sheet
Benzene MSDS

Section 1: Chemical Product and Company Identification

Product Name: Benzene

Catalog Codes: SLB1564, SLB3055, SLB2881

CAS#: 71-43-2

RTECS: CY1400000

TSCA: TSCA 8(b) inventory: Benzene

CI#: Not available.

Synonym: Benzol; Benzine

Chemical Name: Benzene

Chemical Formula: C6-H6

Contact Information:

Sciencelab.com, Inc.
14025 Smith Rd.
Houston, Texas 77396

US Sales: **1-800-901-7247**
International Sales: **1-281-441-4400**

Order Online: ScienceLab.com

CHEMTREC (24HR Emergency Telephone), call:
1-800-424-9300

International CHEMTREC, call: 1-703-527-3887

For non-emergency assistance, call: 1-281-441-4400

Section 2: Composition and Information on Ingredients

Composition:

Name	CAS #	% by Weight
Benzene	71-43-2	100

Toxicological Data on Ingredients: Benzene: ORAL (LD50): Acute: 930 mg/kg [Rat]. 4700 mg/kg [Mouse]. DERMAL (LD50): Acute: >9400 mg/kg [Rabbit]. VAPOR (LC50): Acute: 10000 ppm 7 hours [Rat].

Section 3: Hazards Identification

Potential Acute Health Effects:
Very hazardous in case of eye contact (irritant), of inhalation. Hazardous in case of skin contact (irritant, permeator), of ingestion. Inflammation of the eye is characterized by redness, watering, and itching.

Potential Chronic Health Effects:
CARCINOGENIC EFFECTS: Classified A1 (Confirmed for human.) by ACGIH, 1 (Proven for human.) by IARC. MUTAGENIC EFFECTS: Classified POSSIBLE for human. Mutagenic for mammalian somatic cells. Mutagenic for bacteria and/or yeast. TERATOGENIC EFFECTS: Not available. DEVELOPMENTAL TOXICITY: Classified Reproductive system/toxin/female [POSSIBLE]. The substance is toxic to blood, bone marrow, central nervous system (CNS). The substance may be toxic to liver, Urinary System. Repeated or prolonged exposure to the substance can produce target organs damage.

Section 4: First Aid Measures

Eye Contact:
Check for and remove any contact lenses. In case of contact, immediately flush eyes with plenty of water for at least 15 minutes. Cold water may be used. WARM water MUST be used. Get medical attention immediately.

Skin Contact:
In case of contact, immediately flush skin with plenty of water. Cover the irritated skin with an emollient. Remove contaminated clothing and shoes. Wash clothing before reuse. Thoroughly clean shoes before reuse. Get medical attention.

Serious Skin Contact:
Wash with a disinfectant soap and cover the contaminated skin with an anti-bacterial cream. Seek immediate medical attention.

Inhalation:
If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention if symptoms appear.

Serious Inhalation:
Evacuate the victim to a safe area as soon as possible. Loosen tight clothing such as a collar, tie, belt or waistband. If breathing is difficult, administer oxygen. If the victim is not breathing, perform mouth-to-mouth resuscitation. Seek medical attention.

Ingestion:
Do NOT induce vomiting unless directed to do so by medical personnel. Never give anything by mouth to an unconscious person. If large quantities of this material are swallowed, call a physician immediately. Loosen tight clothing such as a collar, tie, belt or waistband.

Serious Ingestion: Not available.

Section 5: Fire and Explosion Data

Flammability of the Product: Flammable.

Auto-Ignition Temperature: 497.78°C (928°F)

Flash Points: CLOSED CUP: -11.1°C (12°F). (Setaflash)

Flammable Limits: LOWER: 1.2% UPPER: 7.8%

Products of Combustion: These products are carbon oxides (CO, CO2).

Fire Hazards in Presence of Various Substances:
Highly flammable in presence of open flames and sparks, of heat. Slightly flammable to flammable in presence of oxidizing materials. Non-flammable in presence of shocks.

Explosion Hazards in Presence of Various Substances:
Risks of explosion of the product in presence of mechanical impact: Not available. Risks of explosion of the product in presence of static discharge: Not available. Explosive in presence of oxidizing materials, of acids.

Fire Fighting Media and Instructions:
Flammable liquid, soluble or dispersed in water. SMALL FIRE: Use DRY chemical powder. LARGE FIRE: Use alcohol foam, water spray or fog.

Special Remarks on Fire Hazards:
Extremely flammable liquid and vapor. Vapor may cause flash fire. Reacts on contact with iodine heptafluoride gas. Dioxygenyl tetrafluoroborate is as very powferful oxidant. The addition of a small particle to small samples of benzene, at ambient temperature, causes ignition. Contact with sodium peroxide with benzene causes ignition. Benzene ignites in contact with powdered chromic anhydride. Virgorous or incandescent reaction with hydrogen + Raney nickel (above 210 C) and bromine trifluoride.

Special Remarks on Explosion Hazards:
Benzene vapors + chlorine and light causes explosion. Reacts explosively with bromine pentafluoride, chlorine, chlorine trifluoride, diborane, nitric acid, nitryl perchlorate, liquid oxygen, ozone, silver perchlorate. Benzene + pentafluoride and methoxide (from arsenic pentafluoride and potassium methoxide) in trichlorotrifluoroethane causes explosion. Interaction

of nitryl perchlorate with benzene gave a slight explosion and flash. The solution of permanganic acid (or its explosive anhydride, dimaganese heptoxide) produced by interaction of permanganates and sulfuric acid will explode on contact with benzene. Peroxodisulfuric acid is a very powferful oxidant. Uncontrolled contact with benzene may cause explosion. Mixtures of peroxomonsulfuric acid with benzene explodes.

Section 6: Accidental Release Measures

Small Spill: Absorb with an inert material and put the spilled material in an appropriate waste disposal.

Large Spill:
Flammable liquid. Keep away from heat. Keep away from sources of ignition. Stop leak if without risk. Absorb with DRY earth, sand or other non-combustible material. Do not touch spilled material. Prevent entry into sewers, basements or confined areas; dike if needed. Be careful that the product is not present at a concentration level above TLV. Check TLV on the MSDS and with local authorities.

Section 7: Handling and Storage

Precautions:
Keep locked up.. Keep away from heat. Keep away from sources of ignition. Ground all equipment containing material. Do not ingest. Do not breathe gas/fumes/ vapor/spray. In case of insufficient ventilation, wear suitable respiratory equipment. If ingested, seek medical advice immediately and show the container or the label. Avoid contact with skin and eyes. Keep away from incompatibles such as oxidizing agents, acids.

Storage:
Store in a segregated and approved area. Keep container in a cool, well-ventilated area. Keep container tightly closed and sealed until ready for use. Avoid all possible sources of ignition (spark or flame).

Section 8: Exposure Controls/Personal Protection

Engineering Controls:
Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapors below their respective threshold limit value. Ensure that eyewash stations and safety showers are proximal to the work-station location.

Personal Protection:
Splash goggles. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Gloves.

Personal Protection in Case of a Large Spill:
Splash goggles. Full suit. Vapor respirator. Boots. Gloves. A self contained breathing apparatus should be used to avoid inhalation of the product. Suggested protective clothing might not be sufficient; consult a specialist BEFORE handling this product.

Exposure Limits:
TWA: 0.5 STEL: 2.5 (ppm) from ACGIH (TLV) [United States] TWA: 1.6 STEL: 8 (mg/m3) from ACGIH (TLV) [United States] TWA: 0.1 STEL: 1 from NIOSH TWA: 1 STEL: 5 (ppm) from OSHA (PEL) [United States] TWA: 10 (ppm) from OSHA (PEL) [United States] TWA: 3 (ppm) [United Kingdom (UK)] TWA: 1.6 (mg/m3) [United Kingdom (UK)] TWA: 1 (ppm) [Canada] TWA: 3.2 (mg/m3) [Canada] TWA: 0.5 (ppm) [Canada]Consult local authorities for acceptable exposure limits.

Section 9: Physical and Chemical Properties

Physical state and appearance: Liquid.

Odor:
Aromatic. Gasoline-like, rather pleasant. (Strong.)

Taste: Not available.

Molecular Weight: 78.11 g/mole

Color: Clear Colorless. Colorless to light yellow.

pH (1% soln/water): Not available.

Boiling Point: 80.1 (176.2°F)

Melting Point: 5.5°C (41.9°F)

Critical Temperature: 288.9°C (552°F)

Specific Gravity: 0.8787 @ 15 C (Water = 1)

Vapor Pressure: 10 kPa (@ 20°C)

Vapor Density: 2.8 (Air = 1)

Volatility: Not available.

Odor Threshold: 4.68 ppm

Water/Oil Dist. Coeff.: The product is more soluble in oil; log(oil/water) = 2.1

Ionicity (in Water): Not available.

Dispersion Properties: See solubility in water, diethyl ether, acetone.

Solubility:
Miscible in alcohol, chloroform, carbon disulfide oils, carbon tetrachloride, glacial acetic acid, diethyl ether, acetone. Very slightly soluble in cold water.

Section 10: Stability and Reactivity Data

Stability: The product is stable.

Instability Temperature: Not available.

Conditions of Instability: Heat, ignition sources, incompatibles.

Incompatibility with various substances: Highly reactive with oxidizing agents, acids.

Corrosivity: Non-corrosive in presence of glass.

Special Remarks on Reactivity:
Benzene vapors + chlorine and light causes explosion. Reacts explosively with bromine pentafluoride, chlorine, chlorine trifluoride, diborane, nitric acid, nitryl perchlorate, liquid oxygen, ozone, silver perchlorate. Benzene + pentafluoride and methoxide (from arsenic pentafluoride and potassium methoxide) in trichlorotrifluoroethane causes explosion. Interaction of nitryl perchlorate with benzene gave a slight explosion and flash. The solution of permanganic acid (or its explosive anhydride, dimaganese heptoxide) produced by interaction of permanganates and sulfuric acid will explode on contact with benzene. Peroxodisulfuric acid is a very powferful oxidant. Uncontrolled contact with benzene may cause explosion. Mixtures of peroxomonsulfuric acid with benzene explodes.

Special Remarks on Corrosivity: Not available.

Polymerization: Will not occur.

Section 11: Toxicological Information

Routes of Entry: Absorbed through skin. Dermal contact. Eye contact. Inhalation.

Toxicity to Animals:
WARNING: THE LC50 VALUES HEREUNDER ARE ESTIMATED ON THE BASIS OF A 4-HOUR EXPOSURE. Acute oral toxicity (LD50): 930 mg/kg [Rat]. Acute dermal toxicity (LD50): >9400 mg/kg [Rabbit]. Acute toxicity of the vapor (LC50): 10000 7 hours [Rat].

Chronic Effects on Humans:

CARCINOGENIC EFFECTS: Classified A1 (Confirmed for human.) by ACGIH, 1 (Proven for human.) by IARC. MUTAGENIC EFFECTS: Classified POSSIBLE for human. Mutagenic for mammalian somatic cells. Mutagenic for bacteria and/or yeast. DEVELOPMENTAL TOXICITY: Classified Reproductive system/toxin/female [POSSIBLE]. Causes damage to the following organs: blood, bone marrow, central nervous system (CNS). May cause damage to the following organs: liver, Urinary System.

Other Toxic Effects on Humans:
Very hazardous in case of inhalation. Hazardous in case of skin contact (irritant, permeator), of ingestion.

Special Remarks on Toxicity to Animals: Not available.

Special Remarks on Chronic Effects on Humans:
May cause adverse reproductive effects (female fertility, Embryotoxic and/or foetotoxic in animal) and birth defects. May affect genetic material (mutagenic). May cause cancer (tumorigenic, leukemia)) Human: passes the placental barrier, detected in maternal milk.

Special Remarks on other Toxic Effects on Humans:
Acute Potential Health Effects: Skin: Causes skin irritation. It can be absorbed through intact skin and affect the liver, blood, metabolism,and urinary system. Eyes: Causes eye irritation. Inhalation: Causes respiratory tract and mucous membrane irritation. Can be absorbed through the lungs. May affect behavior/Central and Peripheral nervous systems (somnolence, muscle weakness, general anesthetic, and other symptoms similar to ingestion), gastrointestinal tract (nausea), blood metabolism, urinary system. Ingestion: May be harmful if swallowed. May cause gastrointestinal tract irritation including vomiting. May affect behavior/Central and Peripheral nervous systems (convulsions, seizures, tremor, irritability, initial CNS stimulation followed by depression, loss of coordination, dizziness, headache, weakness, pallor, flushing), respiration (breathlessness and chest constriction), cardiovascular system, (shallow/rapid pulse), and blood.

Section 12: Ecological Information

Ecotoxicity: Not available.

BOD5 and COD: Not available.

Products of Biodegradation:
Possibly hazardous short term degradation products are not likely. However, long term degradation products may arise.

Toxicity of the Products of Biodegradation: The products of degradation are less toxic than the product itself.

Special Remarks on the Products of Biodegradation: Not available.

Section 13: Disposal Considerations

Waste Disposal:
Waste must be disposed of in accordance with federal, state and local environmental control regulations.

Section 14: Transport Information

DOT Classification: CLASS 3: Flammable liquid.

Identification: : Benzene UNNA: 1114 PG: II

Special Provisions for Transport: Not available.

Section 15: Other Regulatory Information

Federal and State Regulations:
California prop. 65: This product contains the following ingredients for which the State of California has found to cause cancer, birth defects or other reproductive harm, which would require a warning under the statute: Benzene California prop. 65 (no significant risk level): Benzene: 0.007 mg/day (value) California prop. 65: This product contains the following ingredients

for which the State of California has found to cause cancer which would require a warning under the statute: Benzene Connecticut carcinogen reporting list.: Benzene Connecticut hazardous material survey.: Benzene Illinois toxic substances disclosure to employee act: Benzene Illinois chemical safety act: Benzene New York release reporting list: Benzene Rhode Island RTK hazardous substances: Benzene Pennsylvania RTK: Benzene Minnesota: Benzene Michigan critical material: Benzene Massachusetts RTK: Benzene Massachusetts spill list: Benzene New Jersey: Benzene New Jersey spill list: Benzene Louisiana spill reporting: Benzene California Director's list of Hazardous Substances: Benzene TSCA 8(b) inventory: Benzene SARA 313 toxic chemical notification and release reporting: Benzene CERCLA: Hazardous substances.: Benzene: 10 lbs. (4.536 kg)

Other Regulations:
OSHA: Hazardous by definition of Hazard Communication Standard (29 CFR 1910.1200). EINECS: This product is on the European Inventory of Existing Commercial Chemical Substances.

Other Classifications:

WHMIS (Canada):
CLASS B-2: Flammable liquid with a flash point lower than 37.8°C (100°F). CLASS D-2A: Material causing other toxic effects (VERY TOXIC).

DSCL (EEC):
R11- Highly flammable. R22- Harmful if swallowed. R38- Irritating to skin. R41- Risk of serious damage to eyes. R45- May cause cancer. R62- Possible risk of impaired fertility. S2- Keep out of the reach of children. S26- In case of contact with eyes, rinse immediately with plenty of water and seek medical advice. S39- Wear eye/face protection. S46- If swallowed, seek medical advice immediately and show this container or label. S53- Avoid exposure - obtain special instructions before use.

HMIS (U.S.A.):

Health Hazard: 2

Fire Hazard: 3

Reactivity: 0

Personal Protection: h

National Fire Protection Association (U.S.A.):

Health: 2

Flammability: 3

Reactivity: 0

Specific hazard:

Protective Equipment:
Gloves. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate. Splash goggles.

Section 16: Other Information

References: Not available.


Other Special Considerations: Not available.

Created: 10/10/2005 08:35 PM

Last Updated: 11/06/2008 12:00 PM

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no event shall ScienceLab.com be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if ScienceLab.com has been advised of the possibility of such damages.



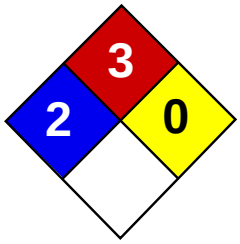



Material Safety Data Sheet
Toluene MSDS

Section 1: Chemical Product and Company Identification

Product Name: Toluene

Catalog Codes: SLT2857, SLT3277

CAS#: 108-88-3

RTECS: XS5250000

TSCA: TSCA 8(b) inventory: Toluene

CI#: Not available.

Synonym: Toluol, Tolu-Sol; Methylbenzene; Methacide; Phenylmethane; Methylbenzol

Chemical Name: Toluene

Chemical Formula: C6-H5-CH3 or C7-H8

Contact Information:

Sciencelab.com, Inc.
14025 Smith Rd.
Houston, Texas 77396

US Sales: **1-800-901-7247**
International Sales: **1-281-441-4400**

Order Online: ScienceLab.com

CHEMTREC (24HR Emergency Telephone), call: 1-800-424-9300

International CHEMTREC, call: 1-703-527-3887

For non-emergency assistance, call: 1-281-441-4400

Section 2: Composition and Information on Ingredients

Composition:

Name	CAS #	% by Weight
Toluene	108-88-3	100

Toxicological Data on Ingredients: Toluene: ORAL (LD50): Acute: 636 mg/kg [Rat]. DERMAL (LD50): Acute: 14100 mg/kg [Rabbit]. VAPOR (LC50): Acute: 49000 mg/m 4 hours [Rat]. 440 ppm 24 hours [Mouse].

Section 3: Hazards Identification

Potential Acute Health Effects:
Hazardous in case of skin contact (irritant), of eye contact (irritant), of ingestion, of inhalation. Slightly hazardous in case of skin contact (permeator).

Potential Chronic Health Effects:
CARCINOGENIC EFFECTS: A4 (Not classifiable for human or animal.) by ACGIH, 3 (Not classifiable for human.) by IARC. MUTAGENIC EFFECTS: Not available. TERATOGENIC EFFECTS: Not available. DEVELOPMENTAL TOXICITY: Not available. The substance may be toxic to blood, kidneys, the nervous system, liver, brain, central nervous system (CNS). Repeated or prolonged exposure to the substance can produce target organs damage.

Section 4: First Aid Measures

Eye Contact:
Check for and remove any contact lenses. In case of contact, immediately flush eyes with plenty of water for at least 15 minutes. Get medical attention.

Skin Contact:
In case of contact, immediately flush skin with plenty of water. Cover the irritated skin with an emollient. Remove contaminated clothing and shoes. Wash clothing before reuse. Thoroughly clean shoes before reuse. Get medical attention.

Serious Skin Contact:
Wash with a disinfectant soap and cover the contaminated skin with an anti-bacterial cream. Seek immediate medical attention.

Inhalation:
If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention.

Serious Inhalation:
Evacuate the victim to a safe area as soon as possible. Loosen tight clothing such as a collar, tie, belt or waistband. If breathing is difficult, administer oxygen. If the victim is not breathing, perform mouth-to-mouth resuscitation. WARNING: It may be hazardous to the person providing aid to give mouth-to-mouth resuscitation when the inhaled material is toxic, infectious or corrosive. Seek medical attention.

Ingestion:
Do NOT induce vomiting unless directed to do so by medical personnel. Never give anything by mouth to an unconscious person. If large quantities of this material are swallowed, call a physician immediately. Loosen tight clothing such as a collar, tie, belt or waistband.

Serious Ingestion: Not available.

Section 5: Fire and Explosion Data

Flammability of the Product: Flammable.

Auto-Ignition Temperature: 480°C (896°F)

Flash Points: CLOSED CUP: 4.4444°C (40°F). (Setaflash) OPEN CUP: 16°C (60.8°F).

Flammable Limits: LOWER: 1.1% UPPER: 7.1%

Products of Combustion: These products are carbon oxides (CO, CO2).

Fire Hazards in Presence of Various Substances:
Flammable in presence of open flames and sparks, of heat. Non-flammable in presence of shocks.

Explosion Hazards in Presence of Various Substances:
Risks of explosion of the product in presence of mechanical impact: Not available. Risks of explosion of the product in presence of static discharge: Not available.

Fire Fighting Media and Instructions:
Flammable liquid, insoluble in water. SMALL FIRE: Use DRY chemical powder. LARGE FIRE: Use water spray or fog.

Special Remarks on Fire Hazards: Not available.

Special Remarks on Explosion Hazards:
Toluene forms explosive reaction with 1,3-dichloro-5,5-dimethyl-2,4-imidazolididione; dinitrogen tetraoxide; concentrated nitric acid, sulfuric acid + nitric acid; N2O4; AgClO4; BrF3; Uranium hexafluoride; sulfur dichloride. Also forms an explosive mixture with tetranitromethane.

Section 6: Accidental Release Measures

Small Spill: Absorb with an inert material and put the spilled material in an appropriate waste disposal.

Large Spill:
Toxic flammable liquid, insoluble or very slightly soluble in water. Keep away from heat. Keep away from sources of ignition. Stop leak if without risk. Absorb with DRY earth, sand or other non-combustible material. Do not get water inside container. Do not touch spilled material. Prevent entry into sewers, basements or confined areas; dike if needed. Call for assistance on disposal. Be careful that the product is not present at a concentration level above TLV. Check TLV on the MSDS and with local authorities.

Section 7: Handling and Storage

Precautions:
Keep away from heat. Keep away from sources of ignition. Ground all equipment containing material. Do not ingest. Do not breathe gas/fumes/ vapor/spray. Wear suitable protective clothing. In case of insufficient ventilation, wear suitable respiratory equipment. If ingested, seek medical advice immediately and show the container or the label. Avoid contact with skin and eyes. Keep away from incompatibles such as oxidizing agents.

Storage:
Store in a segregated and approved area. Keep container in a cool, well-ventilated area. Keep container tightly closed and sealed until ready for use. Avoid all possible sources of ignition (spark or flame).

Section 8: Exposure Controls/Personal Protection

Engineering Controls:
Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapors below their respective threshold limit value. Ensure that eyewash stations and safety showers are proximal to the work-station location.

Personal Protection:
Splash goggles. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Gloves.

Personal Protection in Case of a Large Spill:
Splash goggles. Full suit. Vapor respirator. Boots. Gloves. A self contained breathing apparatus should be used to avoid inhalation of the product. Suggested protective clothing might not be sufficient; consult a specialist BEFORE handling this product.

Exposure Limits:
TWA: 200 STEL: 500 CEIL: 300 (ppm) from OSHA (PEL) [United States] TWA: 50 (ppm) from ACGIH (TLV) [United States] SKIN TWA: 100 STEL: 150 from NIOSH [United States] TWA: 375 STEL: 560 (mg/m3) from NIOSH [United States] Consult local authorities for acceptable exposure limits.

Section 9: Physical and Chemical Properties

Physical state and appearance: Liquid.

Odor: Sweet, pungent, Benzene-like.

Taste: Not available.

Molecular Weight: 92.14 g/mole

Color: Colorless.

pH (1% soln/water): Not applicable.

Boiling Point: 110.6°C (231.1°F)

Melting Point: -95°C (-139°F)

Critical Temperature: 318.6°C (605.5°F)

Specific Gravity: 0.8636 (Water = 1)

Vapor Pressure: 3.8 kPa (@ 25°C)

Vapor Density: 3.1 (Air = 1)

Volatility: Not available.

Odor Threshold: 1.6 ppm

Water/Oil Dist. Coeff.: The product is more soluble in oil; log(oil/water) = 2.7

Ionicity (in Water): Not available.

Dispersion Properties: See solubility in water, diethyl ether, acetone.

Solubility:
Soluble in diethyl ether, acetone. Practically insoluble in cold water. Soluble in ethanol, benzene, chloroform, glacial acetic acid, carbon disulfide. Solubility in water: 0.561 g/l @ 25 deg. C.

Section 10: Stability and Reactivity Data

Stability: The product is stable.

Instability Temperature: Not available.

Conditions of Instability: Heat, ignition sources (flames, sparks, static), incompatible materials

Incompatibility with various substances: Reactive with oxidizing agents.

Corrosivity: Non-corrosive in presence of glass.

Special Remarks on Reactivity:
Incompatible with strong oxidizers, silver perchlorate, sodium difluoride, Tetranitromethane, Uranium Hexafluoride. Frozen Bromine Trifluoride reacts violently with Toluene at -80 deg. C. Reacts chemically with nitrogen oxides, or halogens to form nitrotoluene, nitrobenzene, and nitrophenol and halogenated products, respectively.

Special Remarks on Corrosivity: Not available.

Polymerization: Will not occur.

Section 11: Toxicological Information

Routes of Entry: Absorbed through skin. Dermal contact. Eye contact. Inhalation. Ingestion.

Toxicity to Animals:
WARNING: THE LC50 VALUES HEREUNDER ARE ESTIMATED ON THE BASIS OF A 4-HOUR EXPOSURE. Acute oral toxicity (LD50): 636 mg/kg [Rat]. Acute dermal toxicity (LD50): 14100 mg/kg [Rabbit]. Acute toxicity of the vapor (LC50): 440 24 hours [Mouse].

Chronic Effects on Humans:
CARCINOGENIC EFFECTS: A4 (Not classifiable for human or animal.) by ACGIH, 3 (Not classifiable for human.) by IARC. May cause damage to the following organs: blood, kidneys, the nervous system, liver, brain, central nervous system (CNS).

Other Toxic Effects on Humans:
Hazardous in case of skin contact (irritant), of ingestion, of inhalation. Slightly hazardous in case of skin contact (permeator).

Special Remarks on Toxicity to Animals:
Lowest Published Lethal Dose: LDL [Human] - Route: Oral; Dose: 50 mg/kg LCL [Rabbit] - Route: Inhalation; Dose: 55000 ppm/40min

Special Remarks on Chronic Effects on Humans:
Detected in maternal milk in human. Passes through the placental barrier in human. Embryotoxic and/or foetotoxic in animal. May cause adverse reproductive effects and birth defects (teratogenic). May affect genetic material (mutagenic)

Special Remarks on other Toxic Effects on Humans:

Acute Potential Health Effects: Skin: Causes mild to moderate skin irritation. It can be absorbed to some extent through the skin. Eyes: Cauess mild to moderate eye irritation with a burning sensation. Splash contact with eyes also causes conjunctivitis, blepharospasm, corneal edema, corneal abraisons. This usually resolves in 2 days. Inhalation: Inhalation of vapor may cause respiratory tract irritation causing coughing and wheezing, and nasal discharge. Inhalation of high concentrations may affect behavior and cause central nervous system effects characterized by nausea, headache, dizziness, tremors, restlessness, lightheadedness, exhilaration, memory loss, insomnia, impaired reaction time, drowsiness, ataxia, hallucinations, somnolence, muscle contraction or spasticity, unconsciousness and coma. Inhalation of high concentration of vapor may also affect the cardiovascular system (rapid heart beat, heart palpitations, increased or decreased blood pressure, dysrhythmia,), respiration (acute pulmonary edema, respiratory depression, apnea, asphyxia), cause vision disturbances and dilated pupils, and cause loss of appetite. Ingestion: Aspiration hazard. Aspiration of Toluene into the lungs may cause chemical pneumonitis. May cause irritation of the digestive tract with nausea, vomiting, pain. May have effects similar to that of acute inhalation. Chronic Potential Health Effects: Inhalation and Ingestion: Prolonged or repeated exposure via inhalation may cause central nervous system and cardiovascular symptoms similar to that of acute inhalation and ingestion as well liver damage/failure, kidney damage/failure (with hematuria, proteinuria, oliguria, renal tubular acidosis), brain damage, weight loss, blood (pigmented or nucleated red blood cells, changes in white blood cell count), bone marrow changes, electrolyte imbalances (Hypokalemia, Hypophostatemia), severe, muscle weakness and Rhabdomyolysis. Skin: Repeated or prolonged skin contact may cause defatting dermatitis.

Section 12: Ecological Information

Ecotoxicity:
Ecotoxicity in water (LC50): 313 mg/l 48 hours [Daphnia (daphnia)]. 17 mg/l 24 hours [Fish (Blue Gill)]. 13 mg/l 96 hours [Fish (Blue Gill)]. 56 mg/l 24 hours [Fish (Fathead minnow)]. 34 mg/l 96 hours [Fish (Fathead minnow)]. 56.8 ppm any hours [Fish (Goldfish)].

BOD5 and COD: Not available.

Products of Biodegradation:
Possibly hazardous short term degradation products are not likely. However, long term degradation products may arise.

Toxicity of the Products of Biodegradation: The products of degradation are less toxic than the product itself.

Special Remarks on the Products of Biodegradation: Not available.

Section 13: Disposal Considerations

Waste Disposal:
Waste must be disposed of in accordance with federal, state and local environmental control regulations.

Section 14: Transport Information

DOT Classification: CLASS 3: Flammable liquid.

Identification: : Toluene UNNA: 1294 PG: II

Special Provisions for Transport: Not available.

Section 15: Other Regulatory Information

Federal and State Regulations:
California prop. 65: This product contains the following ingredients for which the State of California has found to cause cancer, birth defects or other reproductive harm, which would require a warning under the statute: Toluene California prop. 65 (no significant risk level): Toluene: 7 mg/day (value) California prop. 65 (acceptable daily intake level): Toluene: 7 mg/day (value) California prop. 65: This product contains the following ingredients for which the State of California has found to cause birth defects which would require a warning under the statute: Toluene Connecticut hazardous material survey.: Toluene Illinois

toxic substances disclosure to employee act: Toluene Illinois chemical safety act: Toluene New York release reporting list: Toluene Rhode Island RTK hazardous substances: Toluene Pennsylvania RTK: Toluene Florida: Toluene Minnesota: Toluene Michigan critical material: Toluene Massachusetts RTK: Toluene Massachusetts spill list: Toluene New Jersey: Toluene New Jersey spill list: Toluene Louisiana spill reporting: Toluene California Director's List of Hazardous Substances.: Toluene TSCA 8(b) inventory: Toluene TSCA 8(d) H and S data reporting: Toluene: Effective date: 10/04/82; Sunset Date: 10/0/92 SARA 313 toxic chemical notification and release reporting: Toluene CERCLA: Hazardous substances.: Toluene: 1000 lbs. (453.6 kg)

Other Regulations:
OSHA: Hazardous by definition of Hazard Communication Standard (29 CFR 1910.1200). EINECS: This product is on the European Inventory of Existing Commercial Chemical Substances.

Other Classifications:

WHMIS (Canada):
CLASS B-2: Flammable liquid with a flash point lower than 37.8°C (100°F). CLASS D-2A: Material causing other toxic effects (VERY TOXIC).

DSCL (EEC):
R11- Highly flammable. R20- Harmful by inhalation. S16- Keep away from sources of ignition - No smoking. S25- Avoid contact with eyes. S29- Do not empty into drains. S33- Take precautionary measures against static discharges.

HMIS (U.S.A.):

Health Hazard: 2

Fire Hazard: 3

Reactivity: 0

Personal Protection: h

National Fire Protection Association (U.S.A.):

Health: 2

Flammability: 3

Reactivity: 0

Specific hazard:

Protective Equipment:
Gloves. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate. Splash goggles.

Section 16: Other Information

References: Not available.


Other Special Considerations: Not available.

Created: 10/10/2005 08:30 PM

Last Updated: 11/06/2008 12:00 PM

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no event shall ScienceLab.com be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if ScienceLab.com has been advised of the possibility of such damages.



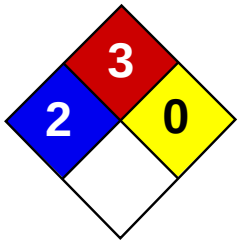



Material Safety Data Sheet
Ethylbenzene MSDS

Section 1: Chemical Product and Company Identification

Product Name: Ethylbenzene

Catalog Codes: SLE2044

CAS#: 100-41-4

RTECS: DA0700000

TSCA: TSCA 8(b) inventory: Ethylbenzene

CI#: Not available.

Synonym: Ethyl Benzene; Ethylbenzol; Phenylethane

Chemical Name: Ethylbenzene

Chemical Formula: C8H10

Contact Information:

Sciencelab.com, Inc.
14025 Smith Rd.
Houston, Texas 77396

US Sales: **1-800-901-7247**
International Sales: **1-281-441-4400**

Order Online: ScienceLab.com

CHEMTREC (24HR Emergency Telephone), call: 1-800-424-9300

International CHEMTREC, call: 1-703-527-3887

For non-emergency assistance, call: 1-281-441-4400

Section 2: Composition and Information on Ingredients

Composition:

Name	CAS #	% by Weight
Ethylbenzene	100-41-4	100

Toxicological Data on Ingredients: Ethylbenzene: ORAL (LD50): Acute: 3500 mg/kg [Rat].

Section 3: Hazards Identification

Potential Acute Health Effects:
Hazardous in case of eye contact (irritant), of ingestion, of inhalation. Slightly hazardous in case of skin contact (irritant, permeator).

Potential Chronic Health Effects:
Slightly hazardous in case of skin contact (irritant, sensitizer). CARCINOGENIC EFFECTS: Classified 2B (Possible for human.) by IARC. MUTAGENIC EFFECTS: Mutagenic for mammalian somatic cells. Mutagenic for bacteria and/or yeast. TERATOGENIC EFFECTS: Not available. DEVELOPMENTAL TOXICITY: Not available. The substance may be toxic to central nervous system (CNS). Repeated or prolonged exposure to the substance can produce target organs damage.

Section 4: First Aid Measures

Eye Contact:

Check for and remove any contact lenses. In case of contact, immediately flush eyes with plenty of water for at least 15 minutes. Cold water may be used. WARM water MUST be used. Get medical attention.

Skin Contact: Wash with soap and water. Cover the irritated skin with an emollient. Get medical attention if irritation develops.

Serious Skin Contact: Not available.

Inhalation:
If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention.

Serious Inhalation:
Evacuate the victim to a safe area as soon as possible. Loosen tight clothing such as a collar, tie, belt or waistband. If breathing is difficult, administer oxygen. If the victim is not breathing, perform mouth-to-mouth resuscitation. WARNING: It may be hazardous to the person providing aid to give mouth-to-mouth resuscitation when the inhaled material is toxic, infectious or corrosive. Seek medical attention.

Ingestion:
Do NOT induce vomiting unless directed to do so by medical personnel. Never give anything by mouth to an unconscious person. Loosen tight clothing such as a collar, tie, belt or waistband. Get medical attention if symptoms appear.

Serious Ingestion: Not available.

Section 5: Fire and Explosion Data

Flammability of the Product: Flammable.

Auto-Ignition Temperature: 432°C (809.6°F)

Flash Points:
CLOSED CUP: 15°C (59°F). (Tagliabue.) OPEN CUP: 26.667°C (80°F) (Cleveland) (CHRIS, 2001) CLOSED CUP: 12.8 C (55 F) (Bingham et al, 2001; NIOSH, 2001) CLOSED CUP: 21 C (70 F) (NFPA)

Flammable Limits: LOWER: 0.8% - 1.6%UPPER: 6.7% - 7%

Products of Combustion: These products are carbon oxides (CO, CO2).

Fire Hazards in Presence of Various Substances: Highly flammable in presence of open flames and sparks, of heat.

Explosion Hazards in Presence of Various Substances:
Risks of explosion of the product in presence of mechanical impact: Not available. Risks of explosion of the product in presence of static discharge: Not available. Slightly explosive in presence of heat.

Fire Fighting Media and Instructions:
Flammable liquid, soluble or dispersed in water. SMALL FIRE: Use DRY chemical powder. LARGE FIRE: Use alcohol foam, water spray or fog.

Special Remarks on Fire Hazards:
Vapor may travel considerable distance to source of ignition and flash back. Vapors may form explosive mixtures with air. When heated to decomposition it emits acrid smoke and irritating fumes.

Special Remarks on Explosion Hazards: Vapors may form explosive mixtures in air.

Section 6: Accidental Release Measures

Small Spill: Absorb with an inert material and put the spilled material in an appropriate waste disposal.

Large Spill:
Flammable liquid. Keep away from heat. Keep away from sources of ignition. Stop leak if without risk. Absorb with DRY earth, sand or other non-combustible material. Do not touch spilled material. Prevent entry into sewers, basements or confined areas; dike if needed. Be careful that the product is not present at a concentration level above TLV. Check TLV on the MSDS and with local authorities.

Section 7: Handling and Storage

Precautions:
Keep away from heat. Keep away from sources of ignition. Ground all equipment containing material. Do not ingest. Do not breathe gas/fumes/ vapor/spray. Avoid contact with eyes. Wear suitable protective clothing. In case of insufficient ventilation, wear suitable respiratory equipment. If ingested, seek medical advice immediately and show the container or the label. Keep away from incompatibles such as oxidizing agents.

Storage:
Store in a segregated and approved area. Keep container in a cool, well-ventilated area. Keep container tightly closed and sealed until ready for use. Avoid all possible sources of ignition (spark or flame). Sensitive to light. Store in light-resistant containers.

Section 8: Exposure Controls/Personal Protection

Engineering Controls:
Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapors below their respective threshold limit value. Ensure that eyewash stations and safety showers are proximal to the work-station location.

Personal Protection:
Splash goggles. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Gloves.

Personal Protection in Case of a Large Spill:
Splash goggles. Full suit. Vapor respirator. Boots. Gloves. A self contained breathing apparatus should be used to avoid inhalation of the product. Suggested protective clothing might not be sufficient; consult a specialist BEFORE handling this product.

Exposure Limits:
TWA: 100 STEL: 125 (ppm) from OSHA (PEL) [United States] TWA: 435 STEL: 545 from OSHA (PEL) [United States] TWA: 435 STEL: 545 (mg/m3) from NIOSH [United States] TWA: 100 STEL: 125 (ppm) from NIOSH [United States] TWA: 100 STEL: 125 (ppm) from ACGIH (TLV) [United States] TWA: 100 STEL: 125 (ppm) [United Kingdom (UK)] TWA: 100 STEL: 125 (ppm) [Belgium] TWA: 100 STEL: 125 (ppm) [Finland] TWA: 50 (ppm) [Norway] Consult local authorities for acceptable exposure limits.

Section 9: Physical and Chemical Properties

Physical state and appearance: Liquid.

Odor: Sweetish. Gasoline-like. Aromatic.

Taste: Not available.

Molecular Weight: 106.16 g/mole

Color: Colorless.

pH (1% soln/water): Not available.

Boiling Point: 136°C (276.8°F)

Melting Point: -94.9 (-138.8°F)

Critical Temperature: 617.15°C (1142.9°F)

Specific Gravity: 0.867 (Water = 1)

Vapor Pressure: 0.9 kPa (@ 20°C)

Vapor Density: 3.66 (Air = 1)

Volatility: 100% (v/v).

Odor Threshold: 140 ppm

Water/Oil Dist. Coeff.: The product is more soluble in oil; log(oil/water) = 3.1

Ionicity (in Water): Not available.

Dispersion Properties: See solubility in water, diethyl ether.

Solubility:
Easily soluble in diethyl ether. Very slightly soluble in cold water or practically insoluble in water. Soluble in all proportions in Ethyl alcohol. Soluble in Carbon tetrachloride, Benzene. Insoluble in Ammonia. Slightly soluble in Chloroform. Solubility in Water: 169 mg/l @ 25 deg. C.; 0.014 g/100 ml @ 15 deg. C.

Section 10: Stability and Reactivity Data

Stability: The product is stable.

Instability Temperature: Not available.

Conditions of Instability: Heat, ingnition sources (flames, sparks, static), incompatible materials, light

Incompatibility with various substances: Reactive with oxidizing agents.

Corrosivity: Not considered to be corrosive for metals and glass.

Special Remarks on Reactivity:
Can react vigorously with oxidizing materials. Sensitive to light.

Special Remarks on Corrosivity: Not available.

Polymerization: Will not occur.

Section 11: Toxicological Information

Routes of Entry: Absorbed through skin. Inhalation.

Toxicity to Animals: Acute oral toxicity (LD50): 3500 mg/kg [Rat].

Chronic Effects on Humans:
CARCINOGENIC EFFECTS: Classified 2B (Possible for human.) by IARC. MUTAGENIC EFFECTS: Mutagenic for mammalian somatic cells. Mutagenic for bacteria and/or yeast. May cause damage to the following organs: central nervous system (CNS).

Other Toxic Effects on Humans:
Hazardous in case of ingestion, of inhalation. Slightly hazardous in case of skin contact (irritant, permeator).

Special Remarks on Toxicity to Animals:
Lethal Dose/Conc 50% Kill: LD50 [Rabbit] - Route: Skin; Dose: 17800 ul/kg Lowest Published Lethal Dose/Conc: LDL[Rat] - Route: Inhalation (vapor); Dose: 4000 ppm/4 H

Special Remarks on Chronic Effects on Humans:
May cause adverse reproductive effects and birth defects (teratogenic) based on animal test data. May cause cancer based on animals data. IARC evidence for carcinogenicity in animals is sufficient. IARC evidence of carcinogenicity in humans inadequate. May affect genetic material (mutagenic).

Special Remarks on other Toxic Effects on Humans:
Acute Potential Health Effects: Skin: Can cause mild skin irritation. It can be absorbed through intact skin. Eyes: Contact with vapor or liquid can cause severe eye irritation depending on concentration. It may also cause conjunctivitis. At a vapor exposure level of 85 - 200 ppm , it is mildly and transiently irritating to the eyes; 1000 ppm causes further irritation and tearing; 2000 ppm results in immediate and severe irritation and tearing; 5,000 ppm is intolerable (ACGIH, 1991; Clayton and Clayton, 1994). Standard draize test for eye irritation using 500 mg resulted in severe irritation (RTECS) Inhalation: Exposure to high concentrations can cause nasal, mucous membrane and respiratory tract irritation and can also result in chest constriction and, trouble breathing, respiratory failure, and even death. It can also affect behavior/Central Nervous System. The effective dose for CNS depression in experimental animals was 10,000 ppm (ACGIH, 1991). Symptoms of CNS depression include

headache, nausea, weakness, dizziness, vertigo, irritability, fatigue, lightheadedness, sleepiness, tremor, loss of coordination, judgement and conciousness, coma, and death. It can also cause pulmonary edema. Inhalation of 85 ppm can produce fatigue, insomnia, headache, and mild irritation of the respiratory tract (Haley & Berndt, 1987). Ingestion: Do not drink, pipet or siphon by mouth. May cause gastroinestinal/digestive tract irritation with Abdominal pain, nausea, vomiting. Ethylbenzene is a pulmonary aspiration hazard. Pulmonary aspiration of even small amounts of the liquid may cause fatal pneumonitis. It may also affect behavior/central nervous system with

Section 12: Ecological Information

Ecotoxicity:
Ecotoxicity in water (LC50): 14 mg/l 96 hours [Fish (Trout)] (static). 12.1 mg/l 96 hours [Fish (Fathead Minnow)] (flow-through)]. 150 mg/l 96 hours [Fish (Blue Gill/Sunfish)] (static). 275 mg/l 96 hours [Fish (Sheepshead Minnow)]. 42.3 mg/l 96 hours [Fish (Fathead Minnow)](soft water). 87.6mg/l 96 hours [Shrimp].

BOD5 and COD: Not available.

Products of Biodegradation:
Possibly hazardous short term degradation products are not likely. However, long term degradation products may arise.

Toxicity of the Products of Biodegradation: The products of degradation are less toxic than the product itself.

Special Remarks on the Products of Biodegradation: Not available.

Section 13: Disposal Considerations

Waste Disposal:
Waste must be disposed of in accordance with federal, state and local environmental control regulations.

Section 14: Transport Information

DOT Classification: CLASS 3: Flammable liquid.

Identification: : Ethylbenzene UNNA: 1175 PG: II

Special Provisions for Transport: Not available.

Section 15: Other Regulatory Information

Federal and State Regulations:
Connecticut hazardous material survey.: Ethylbenzene Illinois toxic substances disclosure to employee act: Ethylbenzene Illinois chemical safety act: Ethylbenzene New York release reporting list: Ethylbenzene Rhode Island RTK hazardous substances: Ethylbenzene Pennsylvania RTK: Ethylbenzene Minnesota: Ethylbenzene Massachusetts RTK: Ethylbenzene Massachusetts spill list: Ethylbenzene New Jersey: Ethylbenzene New Jersey spill list: Ethylbenzene Louisiana spill reporting: Ethylbenzene California Director's List of Hazardous Substances: Ethylbenzene TSCA 8(b) inventory: Ethylbenzene TSCA 4(a) proposed test rules: Ethylbenzene TSCA 8(d) H and S data reporting: Ethylbenzene: Effective Date: 6/19/87; Sunset Date: 6/19/97 SARA 313 toxic chemical notification and release reporting: Ethylbenzene

Other Regulations:
OSHA: Hazardous by definition of Hazard Communication Standard (29 CFR 1910.1200). EINECS: This product is on the European Inventory of Existing Commercial Chemical Substances.

Other Classifications:

WHMIS (Canada):
CLASS B-2: Flammable liquid with a flash point lower than 37.8°C (100°F). CLASS D-2A: Material causing other toxic effects (VERY TOXIC). CLASSE D-2B: Material causing other toxic effects (TOXIC).

DSCL (EEC):
R11- Highly flammable. R20- Harmful by inhalation. S16- Keep away from sources of ignition - No smoking. S24/25- Avoid contact with skin and eyes. S29- Do not empty into drains.

HMIS (U.S.A.):

Health Hazard: 2

Fire Hazard: 3

Reactivity: 0

Personal Protection: h

National Fire Protection Association (U.S.A.):

Health: 2

Flammability: 3

Reactivity: 0

Specific hazard:

Protective Equipment:
Gloves. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate. Splash goggles.

Section 16: Other Information

References:
-Manufacturer's Material Safety Data Sheet. -Fire Protection Guide to Hazardous Materials, 13th ed., National Fire Protection Association (NFPA) -Registry of Toxic Effects of Chemical Substances (RTECS) -Chemical Hazard Response Information System (CHRIS) -Hazardous Substance Data Bank (HSDB) -New Jersey Hazardous Substance Fact Sheet -Ariel Global View -Reprotext System


Other Special Considerations: Not available.

Created: 10/09/2005 05:28 PM

Last Updated: 11/06/2008 12:00 PM

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no event shall ScienceLab.com be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if ScienceLab.com has been advised of the possibility of such damages.



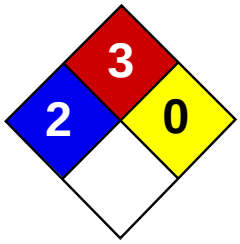



Material Safety Data Sheet
Xylenes MSDS

Section 1: Chemical Product and Company Identification

Product Name: Xylenes

Catalog Codes: SLX1075, SLX1129, SLX1042, SLX1096

CAS#: 1330-20-7

RTECS: ZE2100000

TSCA: TSCA 8(b) inventory: Xylenes

CI#: Not available.

Synonym: Xylenes; Dimethylbenzene; xylol; methyltoluene

Chemical Name: Xylenes (o-, m-, p- isomers)

Chemical Formula: C6H4(CH3)2

Contact Information:

Sciencelab.com, Inc.
14025 Smith Rd.
Houston, Texas 77396

US Sales: **1-800-901-7247**
International Sales: **1-281-441-4400**

Order Online: ScienceLab.com

CHEMTREC (24HR Emergency Telephone), call: 1-800-424-9300

International CHEMTREC, call: 1-703-527-3887

For non-emergency assistance, call: 1-281-441-4400

Section 2: Composition and Information on Ingredients

Composition:

Name	CAS #	% by Weight
Xylenes	1330-20-7	100

Toxicological Data on Ingredients: Xylenes: ORAL (LD50): Acute: 4300 mg/kg [Rat]. 2119 mg/kg [Mouse]. DERMAL (LD50): Acute: >1700 mg/kg [Rabbit].

Section 3: Hazards Identification

Potential Acute Health Effects: Hazardous in case of skin contact (irritant, permeator), of eye contact (irritant), of ingestion, of inhalation.

Potential Chronic Health Effects:
CARCINOGENIC EFFECTS: 3 (Not classifiable for human.) by IARC. MUTAGENIC EFFECTS: Not available. TERATOGENIC EFFECTS: Not available. DEVELOPMENTAL TOXICITY: Not available. The substance may be toxic to blood, kidneys, liver, mucous membranes, bone marrow, central nervous system (CNS). Repeated or prolonged exposure to the substance can produce target organs damage.

Section 4: First Aid Measures

Eye Contact:

Check for and remove any contact lenses. In case of contact, immediately flush eyes with plenty of water for at least 15 minutes. Get medical attention.

Skin Contact:
In case of contact, immediately flush skin with plenty of water. Cover the irritated skin with an emollient. Remove contaminated clothing and shoes. Wash clothing before reuse. Thoroughly clean shoes before reuse. Get medical attention.

Serious Skin Contact:
Wash with a disinfectant soap and cover the contaminated skin with an anti-bacterial cream. Seek immediate medical attention.

Inhalation:
If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention if symptoms appear.

Serious Inhalation:
Evacuate the victim to a safe area as soon as possible. Loosen tight clothing such as a collar, tie, belt or waistband. If breathing is difficult, administer oxygen. If the victim is not breathing, perform mouth-to-mouth resuscitation. Seek medical attention.

Ingestion:
Do NOT induce vomiting unless directed to do so by medical personnel. Never give anything by mouth to an unconscious person. Loosen tight clothing such as a collar, tie, belt or waistband. Get medical attention if symptoms appear.

Serious Ingestion: Not available.

Section 5: Fire and Explosion Data

Flammability of the Product: Flammable.

Auto-Ignition Temperature: 464°C (867.2°F)

Flash Points: CLOSED CUP: 24°C (75.2°F). (Tagliabue.) OPEN CUP: 37.8°C (100°F).

Flammable Limits: LOWER: 1% UPPER: 7%

Products of Combustion: These products are carbon oxides (CO, CO2).

Fire Hazards in Presence of Various Substances:
Highly flammable in presence of open flames and sparks, of heat. Non-flammable in presence of shocks.

Explosion Hazards in Presence of Various Substances:
Risks of explosion of the product in presence of mechanical impact: Not available. Slightly explosive in presence of open flames and sparks, of heat.

Fire Fighting Media and Instructions:
Flammable liquid, soluble or dispersed in water. SMALL FIRE: Use DRY chemical powder. LARGE FIRE: Use alcohol foam, water spray or fog. Cool containing vessels with water jet in order to prevent pressure build-up, autoignition or explosion.

Special Remarks on Fire Hazards: Vapors may travel to source of ignition and flash back.

Special Remarks on Explosion Hazards:
Vapors may form explosive mixtures with air. Containers may explode when heated. May polymerize explosively when heated. An attempt to chlorinate xylene with 1,3-Dichloro-5,5-dimethyl-2,4-imidazolidindione (dichlorohydrantoin) caused a violent explosion

Section 6: Accidental Release Measures

Small Spill: Absorb with an inert material and put the spilled material in an appropriate waste disposal.

Large Spill:
Flammable liquid. Keep away from heat. Keep away from sources of ignition. Stop leak if without risk. Absorb with DRY earth, sand or other non-combustible material. Do not touch spilled material. Prevent entry into sewers, basements or confined

areas; dike if needed. Be careful that the product is not present at a concentration level above TLV. Check TLV on the MSDS and with local authorities.

Section 7: Handling and Storage

Precautions:
Keep away from heat. Keep away from sources of ignition. Ground all equipment containing material. Do not ingest. Do not breathe gas/fumes/ vapor/spray. Wear suitable protective clothing. In case of insufficient ventilation, wear suitable respiratory equipment. If ingested, seek medical advice immediately and show the container or the label. Avoid contact with skin and eyes. Keep away from incompatibles such as oxidizing agents, acids.

Storage:
Store in a segregated and approved area. Keep container in a cool, well-ventilated area. Keep container tightly closed and sealed until ready for use. Avoid all possible sources of ignition (spark or flame).

Section 8: Exposure Controls/Personal Protection

Engineering Controls:
Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapors below their respective threshold limit value. Ensure that eyewash stations and safety showers are proximal to the work-station location.

Personal Protection:
Splash goggles. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Gloves.

Personal Protection in Case of a Large Spill:
Splash goggles. Full suit. Vapor respirator. Boots. Gloves. A self contained breathing apparatus should be used to avoid inhalation of the product. Suggested protective clothing might not be sufficient; consult a specialist BEFORE handling this product.

Exposure Limits:
TWA: 100 (ppm) [Canada] TWA: 435 (mg/m3) [Canada] TWA: 434 STEL: 651 (mg/m3) from ACGIH (TLV) [United States] TWA: 100 STEL: 150 (ppm) from ACGIH (TLV) [United States] Consult local authorities for acceptable exposure limits.

Section 9: Physical and Chemical Properties

Physical state and appearance: Liquid.

Odor: Sweetish.

Taste: Not available.

Molecular Weight: 106.17 g/mole

Color: Colorless. Clear

pH (1% soln/water): Not available.

Boiling Point: 138.5°C (281.3°F)

Melting Point: -47.4°C (-53.3°F)

Critical Temperature: Not available.

Specific Gravity: 0.864 (Water = 1)

Vapor Pressure: 0.9 kPa (@ 20°C)

Vapor Density: 3.7 (Air = 1)

Volatility: Not available.

Odor Threshold: 1 ppm

Water/Oil Dist. Coeff.: The product is more soluble in oil; log(oil/water) = 3.1

Ionicity (in Water): Not available.

Dispersion Properties: Not available.

Solubility:
Insoluble in cold water, hot water. Miscible with absolute alcohol, ether, and many other organic liquids.

Section 10: Stability and Reactivity Data

Stability: The product is stable.

Instability Temperature: Not available.

Conditions of Instability: Heat, ignition sources, incompatibles

Incompatibility with various substances: Reactive with oxidizing agents, acids.

Corrosivity: Non-corrosive in presence of glass.

Special Remarks on Reactivity: Store away from acetic acid, nitric acid, chlorine, bromine, and fluorine.

Special Remarks on Corrosivity: Not available.

Polymerization: Will not occur.

Section 11: Toxicological Information

Routes of Entry: Absorbed through skin. Dermal contact. Eye contact. Inhalation.

Toxicity to Animals:
WARNING: THE LC50 VALUES HEREUNDER ARE ESTIMATED ON THE BASIS OF A 4-HOUR EXPOSURE. Acute oral toxicity (LD50): 2119 mg/kg [Mouse]. Acute dermal toxicity (LD50): >1700 mg/kg [Rabbit]. Acute toxicity of the vapor (LC50): 5000 4 hours [Rat].

Chronic Effects on Humans:
CARCINOGENIC EFFECTS: 3 (Not classifiable for human.) by IARC. May cause damage to the following organs: blood, kidneys, liver, mucous membranes, bone marrow, central nervous system (CNS).

Other Toxic Effects on Humans: Hazardous in case of skin contact (irritant, permeator), of ingestion, of inhalation.

Special Remarks on Toxicity to Animals:
Lowest Lethal Dose: LDL [Human] - Route: Oral; Dose: 50 mg/kg LCL [Man] - Route: Oral; Dose: 10000 ppm/6H

Special Remarks on Chronic Effects on Humans:
Detected in maternal milk in human. Passes through the placental barrier in animal. Embryotoxic and/or foetotoxic in animal. May cause adverse reproductive effects (male and femael fertility (spontaneous abortion and fetotoxicity)) and birth defects based animal data.

Special Remarks on other Toxic Effects on Humans:
Acute Potential Health Effects: Skin: Causes skin irritation. Can be absorbed through skin. Eyes: Causes eye irritation. Inhalation: Vapor causes respiratory tract and mucous membrane irritation. May affect central nervous system and behavior (General anesthetic/CNS depressant with effects including headache, weakness, memory loss, irritability, dizziness, giddiness, loss of coordination and judgement, respiratory depression/arrest or difficulty breathing, loss of appetite, nausea, vomiting, shivering, and possible coma and death). May also affects blood, sense organs, liver, and peripheral nerves. Ingestion: May cause gastrointestinal irritation including abdominal pain, vomiting, and nausea. May also affect liver and urinary system/ kidneys. May cause effects similar to those of acute inhalation. Chronic Potential Health Effects: Chronic inhalation may affect the urinary system (kidneys) blood (anemia), bone marrow (hyperplasia of bone marrow) brain/behavior/Central Nervous system. Chronic inhalation may alsocause mucosal bleeding. Chronic ingestion may affect the liver and metabolism (loss of appetite) and may affect urinary system (kidney damage)

Section 12: Ecological Information

Ecotoxicity: Not available.

BOD5 and COD: Not available.

Products of Biodegradation:
Possibly hazardous short term degradation products are not likely. However, long term degradation products may arise.

Toxicity of the Products of Biodegradation: The products of degradation are less toxic than the product itself.

Special Remarks on the Products of Biodegradation: Not available.

Section 13: Disposal Considerations

Waste Disposal:
Waste must be disposed of in accordance with federal, state and local environmental control regulations.

Section 14: Transport Information

DOT Classification: CLASS 3: Flammable liquid.

Identification: : Xylenes UNNA: 1307 PG: III

Special Provisions for Transport: Not available.

Section 15: Other Regulatory Information

Federal and State Regulations:
Connecticut hazardous material survey.: Xylenes Illinois chemical safety act: Xylenes New York acutely hazardous substances: Xylenes Rhode Island RTK hazardous substances: Xylenes Pennsylvania RTK: Xylenes Minnesota: Xylenes Michigan critical material: Xylenes Massachusetts RTK: Xylenes Massachusetts spill list: Xylenes New Jersey: Xylenes New Jersey spill list: Xylenes Louisiana spill reporting: Xylenes California Director's List of Hazardous Substances: Xylenes TSCA 8(b) inventory: Xylenes SARA 302/304/311/312 hazardous chemicals: Xylenes SARA 313 toxic chemical notification and release reporting: Xylenes CERCLA: Hazardous substances.: Xylenes: 100 lbs. (45.36 kg)

Other Regulations:
OSHA: Hazardous by definition of Hazard Communication Standard (29 CFR 1910.1200). EINECS: This product is on the European Inventory of Existing Commercial Chemical Substances.

Other Classifications:

WHMIS (Canada):
CLASS B-2: Flammable liquid with a flash point lower than 37.8°C (100°F). CLASS D-2A: Material causing other toxic effects (VERY TOXIC).

DSCL (EEC):
R10- Flammable. R21- Harmful in contact with skin. R36/38- Irritating to eyes and skin. S2- Keep out of the reach of children. S36/37- Wear suitable protective clothing and gloves. S46- If swallowed, seek medical advice immediately and show this container or label.

HMIS (U.S.A.):

Health Hazard: 2

Fire Hazard: 3

Reactivity: 0

Personal Protection: h

National Fire Protection Association (U.S.A.):

Health: 2

Flammability: 3

Reactivity: 0

Specific hazard:

Protective Equipment:
Gloves. Lab coat. Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate. Splash goggles.

Section 16: Other Information

References: Not available.

Other Special Considerations: Not available.

Created: 10/11/2005 12:54 PM

Last Updated: 11/06/2008 12:00 PM

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no event shall ScienceLab.com be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if ScienceLab.com has been advised of the possibility of such damages.

MATERIAL SAFETY DATA SHEET

SECTION 1 ◆ PRODUCT AND COMPANY IDENTIFICATION

Explorer Pipeline Company 6846 South Canton P.O. Box 2650 Tulsa, Oklahoma 74101	**FOR EMERGENCY SOURCE INFORMATION CONTACT:** ➢ (918) 493 - 5100 ➢ CHEMTREC: (800) 424-9300 (24 hour contact) ➢ CANUTEC: (613) 996-6666 ➢ SETIQ: 91-800-00214

TRADE NAMES/SYNONYMS: Methyl Tertiary Butyl Ether, Methyl Ether, Butyl Ether, or MTBE	**CHEMICAL FAMILY:** Alkyl Ethyl	**EPL Code:** 17

This material safety data sheet represents the composite characteristics and properties of fungible petroleum hydrocarbons and other related substances transported by explorer pipeline company. The information presented was compiled from one or more product shipper sources and is intended to provide health and safety guidance for these fungible products. Individual shipper and manufacturer MSDSs are available at Explorer Pipeline Company's, Tulsa, Oklahoma, offices.

SECTION 2 ✷ HAZARDS IDENTIFICATION

EMERGENCY OVERVIEW

DANGER! EXTREMELY FLAMMABLE LIQUID

- Clear, colorless liquid with ether-like odor;
- Eye and mucous membrane irritant - effects central Nervous system - harmful or fatal if swallowed - aspiration hazard;
- High fire hazard. Keep away from heat, spark, open flame, and other ignition sources;
- Contact may cause eye, skin and mucous membrane irritation. Avoid prolonged breathing of vapors or mists;
- Inhalation may cause irritation, anesthetic effects (dizziness, nausea, headache, intoxication), and respiratory system effects;
- If ingested, do NOT induce vomiting, as this may cause chemical pneumonia (fluid in the lungs); and
- Obtain prompt medical attention. Keep Out of Reach of Children!

SECTION 3 ▼ COMPOSITION/INFORMATION OF INGREDIENTS

INGREDIENT	CAS NUMBER	PERCENTAGE (%)
Methyl Tertiary Butyl Ether	1634-04-4	97+%

ACUTE

GETTING IT IN YOUR EYE...

- May cause minor eye irritation.

GETTING IT ON YOUR SKIN...

- No significant signs or symptoms indicative of any health hazard are expected to occur as a result of skin absorption exposure.
- May produce skin irritation.

SWALLOWING IT...

- The major health threat of ingestion occurs from the danger of aspiration (breathing) of liquid drops into the lungs, particularly from vomiting. Aspiration may result in chemical pneumonia (fluid in the lungs), severe lung damage, respiratory failure and even death.

BREATHING IT...

- Excessive exposure may cause irritation to the nose, throat, lungs and respiratory tract. Central nervous system (brain) effects may include headache, dizziness, loss of balance and coordination, unconsciousness, coma, respiratory failure, and death.

CHRONIC

- Medical information regarding special health effects is not conclusive.

CANCER, REPRODUCTIVE AND GENETIC EFFECTS

- This product has produced cancer, developmental and systemic toxicity in laboratory animals following repeated exposure. The significance of these results to human exposures has not been determined.

See Toxicological Information (Section 11) For More Information

SECTION 4 ✣ FIRST AID MEASURES

EYES: In case of eye contact, immediately rinse with clean water for 20-30 minutes. Retract eyelids often. Obtain emergency medical attention if pain, blinking, tears or redness persist.

SKIN: Immediately remove contaminated clothing. Wash skin thoroughly with mild soap/water. Flush with lukewarm water for 15 minutes. If sticky, use waterless cleaner first.

INGESTION: If large quantity swallowed, give lukewarm water (pint) if victim completely conscious/alert. Do not induce vomiting/risk of damage to lungs exceeds poisoning risk. Obtain emergency medical attention.

INHALATION: If overcome by exposure, remove victim to fresh air immediately. Give oxygen or artificial respiration as needed. Obtain emergency medical attention. Prompt action is essential.

NOTE TO PHYSICIAN: TREAT SYMPTOMATICALLY AND SUPPORTIVELY

SECTION 5 ⌘ FIRE FIGHTING MEASURES

Releases flammable vapors below normal ambient temperatures. When mixed with air and exposed to ignition source, vapors can burn in open or explode if confined. Flammable vapors may be heavier than air. May travel long distances along ground before igniting/flashing back to vapor source.

FLASH POINT:(Method Used) -30°F	**FLAMMABLE LIMITS:** LEL: 1.0% UEL: 8.0%

AUTOIGNITION TEMPERATURE: 797°F

EXTINGUISHING MEDIA: Dry Chemical, CO_2, Foam for Alcohols, Water spray, and fog to cool exposures

HAZARDOUS REACTIONS/DECOMPOSITION: Combustion may produce carbon monoxide, carbon dioxide, and acrid fumes. Incomplete combustion generates highly poisonous carbon monoxide and perhaps other toxic gases.

SPECIAL INSTRUCTIONS: Do not enter fire area without proper protection. Decomposition products possible. Fight fires from safe distance/protected location. Heat may build pressure/rupture closed containers, spreading fire, increasing risk of burns/injuries. Water may be ineffective due to low flash point. Even if material is water soluble, may not be practicable to extinguish fire by water dilution. Apply water spray/fog for cooling. Notify authorities if liquid enters sewer/public waters.

SECTION 6 ❖ ACCIDENTAL RELEASE MEASURES

- Flammable liquid. Release can cause fire/explosion. Liquids/vapors may ignite. Evacuate/limit access. Equip responders with proper protection. Kill all ignition sources. Stop release. Prevent flow to sewers/public waters. Notify fire/environmental authorities. Blanket with firefighting foam. Restrict water use for cleanup. Impound/recover large land spill. Soak up small spill with inert solids. Use suitable disposal containers. On water material partially soluble/may float or sink. Contain/minimize dispersion/collect. Disperse residue to reduce aquatic harm.

SECTION 7 ⚒ HANDLING AND STORAGE

Prior to working with this product workers should be trained on its proper handling and storage

- Store in tightly closed/properly vented containers away from heat/sparks/open flame/strong oxidizers. Use only non-sparking tools. Store drums with bung in up position. Carefully vent internal pressure before removing closure. Containers must be grounded before transfer. Electrical equipment should conform to National Electric Code. Handle used containers with care; residue may be flammable/explosive, unless blanketed with inert gas.
- Isolate, vent, drain, wash, and purge equipment before maintenance. Remove all ignition sources, check atmosphere for explosiveness and oxygen deficiencies. Use adequate personal protective equipment. Observe precautions pertaining to confined space entry.

SECTION 8 ⊕ EXPOSURE CONTROLS / PERSONAL PROTECTION

ENGINEERING CONTROLS: No special ventilation is usually required beyond that needed for normal comfort control.

OTHER HYGIENIC AND WORK PRACTICES: Emergency eye wash fountains and safety showers should be available in the immediate vicinity or any potential exposure. Use good personal hygiene practices. Wash hands before eating, drinking, smoking, or using toilet facilities. Promptly remove soiled clothing/wash thoroughly before reuse. Shower after work using plenty of soap and water.

EXPOSURE LIMITS

OSHA PEL		ACGIH TLV (2005)	
METHYL TERT BUTYL ETHER			
TWA	STEL	TWA	STEL
Not Applicable (N.A.)	N.A.	50 ppm	N.A.

PERSONAL PROTECTIVE EQUIPMENT

- **EYES:** Eye protection such as chemical splash goggles and/or face shield must be worn when possibility exists for eye contact due to splashing or spraying liquid, airborne particles, or vapor. Contact lenses should not be worn.
- **SKIN:** Depending on the conditions of use, protective gloves, apron, boots, head and face protection should be worn. This equipment should be cleaned thoroughly after each use.
- **RESPIRATORY PROTECTION:** No occupational exposure standards have been developed for this material. Where exposure through inhalation may occur from use, NIOSH/MSHA approved respiratory protection is recommended.

SECTION 9 ϟ PHYSICAL AND CHEMICAL PROPERTIES

BOILING POINT (760 MM HG): 131°F	**PERCENT VOLATILE BY VOLUME:** 100%
SPECIFIC GRAVITY (H_2O = 1): 0.74 @ 68°F	**VISCOSITY UNITS, TEMP:** No Data
FREEZING POINT: -164°F	**VAPOR DENSITY (AIR =1):** 3.1
VAPOR PRESSURE AT 68°F: 75 mm Hg	**SOLUBILITY IN WATER:** Approximately 4% to 5%
APPEARANCE AND ODOR: Clear, colorless liquid with ether-like odor.	

SECTION 10 ¤ STABILITY AND REACTIVITY

CHEMICAL STABILITY: Stable

CONDITIONS TO AVOID: High temperature, open flame or spark.

OTHER PHYSICAL AND CHEMICAL PROPERTIES: No Data

MATERIALS TO AVOID: Strong oxidizing agents, ungrounded electrical equipment, open flames and spark.

HAZARDOUS POLYMERIZATION: Not Expected to Occur

SECTION 11 ֍ TOXICOLOGICAL INFORMATION

METHYL TERT BUTYL ETHER (MTBE)

Acute symptoms associated with human exposure to MTBE appear to be mild and transient. Breathing small amounts of MTBE for short periods may cause nose and throat irritation. In laboratory studies, rodents exposed to high doses of MTBE exhibited blood chemistry changes and liver and kidney abnormalities.

TOXICITY

Type Of Dose	Specie	Result	Type Of Dose	Specie	Result	Type Of Dose	Specie	Result
$LD_{50(oral)}$	Mouse	3,500 mg/kg	$LC_{50(inh)}$	Mouse	35,000 ppm	$LD_{LO(oral)}$	Human	No Data Available

CARCINOGENICITY

IARC	Sufficient evidence in animals	Inadequate evidence in humans	Group 3: Possible human carcinogen
NTP	Not identified as a Know Carcinogen or Anticipated Human Carcinogen		

California (Prop 65): Listed as carcinogen	NIOSH: Not Listed	ACGIH: A3 – Confirmed Animal	OSHA: not classifiable as a human carcinogen

MUTAGENICITY, TERATOGENICITY AND REPRODUCTIVE EFFECTS

In laboratory studies, MTBE vapor exposure at the high dose concentration was associated with an increased incidence of liver tumors in female mice. Also, at high dose concentration exposures, MTBE was associated with an increased incidence of kidney and testicular (Leydig cell) tumors in male rats. There is no evidence that MTBE causes cancer in humans.

SECTION 12 ❋ ECOLOGICAL INFORMATION

ACUTE EFFECTS: MTBE is considered moderately toxicity to aquatic life. Insufficient data are available to evaluate or predict the short-term effects to birds or land animals.

CHRONIC EFFECTS: MTBE is considered moderately toxicity to aquatic life. Insufficient data are available to evaluate or predict the long-term effects to birds or land animals.

DISTRIBUTION AND PERSISTENCE IN THE ENVIRONMENT: MTBE evaporates when exposed to air. It dissolves when mixed with water. Most direct releases of MTBE to the environment are to air. MTBE also evaporates from water and soil exposed to air. Once in air, it is expected to break down to other chemicals. Because it is a liquid that does not bind well to soil, MTBE that makes its way into the ground can move through the ground and enter groundwater. Plants and animals are not likely to store methyl tertiary-butyl ether..

SECTION 13 ✣ DISPOSAL CONSIDERATIONS

Contaminated product/soil/water may be RCRA/OSHA hazardous waste due to low flash point. Use registered transporters. Dilute aqueous waste may biodegrade.

SECTION 14 ★ TRANSPORTATION INFORMATION

Not Meant To Be All Inclusive - Check Local, State, And Federal Laws And Regulations


Agency	Shipping Name	Packing Group	Hazard Class	UN/NA #
U.S. DOT	Methyl tert-butyl ether	II	Flammable Liquid	UN 2398

SECTION 15 ☽ REGULATORY INFORMATION

CERCLA RQ's (40 CFR Part 302)	MTBE - 1,000 pounds
RCRA	Not Listed
SARA (40 CFR Part 355) TPQ's	None of the ingredients are listed
SARA Title III Section 313	All ingredients listed
California's Prop 65	All ingredients listed
OSHA	All ingredients are listed as hazardous under 29 CFR 1910.1200

SECTION 16 ❁ OTHER INFORMATION

NFPA 704 LABEL:

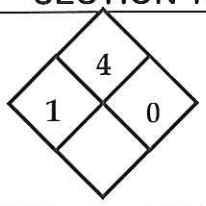

HMIS LABEL

1-4-0

MSDS REVISIONS: Change in Format and update of Information

MSDS CREATION DATE: July 1997 | **REVISION #1:** 01/03/06

DISCLAIMER

The information in this MSDS was obtained from sources which we believe are reliable. **HOWEVER, THE INFORMATION IS PROVIDED WITHOUT ANY WARRANTY, EXPRESS OR IMPLIED, REGARDING ITS ACCURACY.** Some conditions or methods of handling, storage, use and disposal of the product are beyond our control and may be beyond our knowledge. **FOR THIS AND OTHER REASONS, WE DO NOT ASSUME RESPONSIBILITY AND EXPRESSLY DISCLAIM LIABILITY FOR LOSS, DAMAGE OR EXPENSE ARISING OUT OR IN ANY WAY CONNECTED WITH THE HANDLING, STORAGE, USE OR DISPOSAL OF THE PRODUCT.** All product measurements such as flash point, *etc.* are considered approximate values. All data provided by Explorer Pipeline Company.

This MSDS was prepared and is to be used only for this product. If the product is used as a component in another product, such as refined petroleum hydrocarbon mixtures, this MSDS information may not be applicable.


MSDS DEVELOPER: Cass Willard

Cass Willard, CIH

DATE: 01/03/06

Material Safety Data Sheet
Fuel Oil

NFPA:

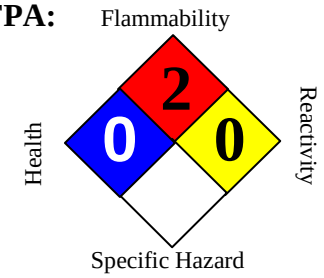

SECTION 1. PRODUCT AND COMPANY IDENTIFICATION

Product name	:	Fuel Oil
Synonyms	:	Bunkers, Black Fuel Oil, MFO, Industrial Fuel Oil, 6 Oil, Slurry Fuel Oil, RFO, Refinery Fuel Oil, High Sulfur Fuel Oil, HSFO, IFO-30, IFO-180, IFO-380, IFO-510, IFO-700, Bunker C, Bunker Fuel Oil, Marine Fuel Oil, Decant Oil, Utility Fuel Oil, LSFO, Six Oil, 888100008793
SDS Number	:	888100008793 **Version** : 1.20
Product Use Description	:	Fuel, Intermediate Stream
Company	:	For: Tesoro Refining & Marketing Co. 19100 Ridgewood Parkway, San Antonio, TX 78259
Tesoro Call Center	:	(877) 783-7676 **Chemtrec (Emergency Contact)** : (800) 424-9300

SECTION 2. HAZARDS IDENTIFICATION

Classifications

Flammable Liquid – Category 4
Carcinogenicity – Category 1B
Toxic to Reproduction – Category 1B
Specific Target Organ Toxicity (Repeated Exposure) – Category 2
Acute Toxicity – Inhalation – Category 4
Acute Aquatic Toxicity– Category 3

Pictograms



Signal Word

DANGER

Hazard Statements

Combustible liquid.
May cause cancer from prolonged and repeated skin contact.
May damage fertility or the unborn child.
May cause damage to liver, kidney and nervous system through prolonged or repeated exposure.
Harmful if inhaled.
Harmful to aquatic life
Skin and eye irritant.
May contain and release toxic hydrogen sulfide (H2S) gas.

Precautionary Statements

Prevention	Obtain special instructions before use. Do not handle until all safety precautions have been read and understood. Keep away from flames and hot surfaces. No smoking. Wear gloves, eye protection and face protection as needed to prevent skin and eye contact with liquid. Wash hands or liquid-contacted skin thoroughly after handling. Do not eat, drink or smoke when using this product. Do not breathe vapors or mists. Use only outdoors or in a well-ventilated area
Response	In case of fire: Use dry chemical, CO2, water spray or fire fighting foam to extinguish. Get medical advice or attention if you feel unwell, are exposed, or become concerned. If on skin (or hair): Take off immediately all contaminated clothing. Rinse skin with water or shower. If in eye: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. If skin or eye irritation persists, get medical attention. If inhaled: Remove person to fresh air and keep comfortable for breathing. Immediately call or doctor or emergency medical provider
Storage	Store in a well ventilated place. Keep cool. Store locked up. Keep container tightly closed . Use only approved containers.
Disposal	Dispose of contents/containers to approved disposal site in accordance with local, regional, national, and/or international regulations.

SECTION 3. COMPOSITION/INFORMATION ON INGREDIENTS

Component	CAS-No.	Weight %
Clarified oils (petroleum), catalytic cracked; Heavy Fuel oil	64741-62-4	100%
Polycyclic aromatic compounds (PACs or PNAs)		Typically 1.5%
Benzo[a]pyrene; Benzo[def]chrysene	50-32-8	Trace to 0.2%
Hydrogen Sulfide	7783-06-4	Trace to 0.2%
Sulfur (for waters within 25 miles of California shores)	17704-34-9	Trace to 0.1%
Sulfur (for waters within 200 miles of American shores)	17704-34-9	Trace to 1.0%
Sulfur (for International waters)	17704-34-9	Trace to 3.5%

SECTION 4. FIRST AID MEASURES

Inhalation : Move to fresh air. Give oxygen. If breathing is irregular or stopped, administer artificial respiration. Seek medical attention immediately.

Skin contact : Take off all contaminated clothing immediately. Wash off immediately with soap

and plenty of water. Wash contaminated clothing before re-use. If skin irritation persists, call a physician.

Eye contact : Remove contact lenses. Rinse immediately with plenty of water, also under the eyelids, for at least 15 minutes. If eye irritation persists, consult a specialist.

Ingestion : Do NOT induce vomiting. Do not give liquids. Seek medical attention immediately. If vomiting does occur naturally, keep head below the hips to reduce the risks of aspiration. Monitor for breathing difficulties. Small amounts of material which enter the mouth should be rinsed out until the taste is dissipated.

Notes to physician : Symptoms: Dizziness, Discomfort, Headache, Nausea, Disorder, Vomiting, Liver disorders, Kidney disorders, Aspiration may cause pulmonary edema and pneumonitis.

SECTION 5. FIRE-FIGHTING MEASURES

Suitable extinguishing media : Carbon dioxide (CO2), Water spray, Dry chemical, Foam, Keep containers and surroundings cool with water spray.

Specific hazards during fire fighting : Isolate area around container involved in fire. Cool tanks, shells, and containers exposed to fire and excessive heat with water. For massive fires the use of unmanned hose holders or monitor nozzles may be advantageous to further minimize personnel exposure. Major fires may require withdrawal, allowing the tank to burn. Large storage tank fires typically require specially trained personnel and equipment to extinguish the fire, often including the need for properly applied fire fighting foam.

Special protective equipment for fire-fighters : Firefighting activities that may result in potential exposure to high heat, smoke or toxic by-products of combustion should require NIOSH/MSHA- approved pressure-demand self-contained breathing apparatus with full facepiece and full protective clothing.

Further information : Flammable vapor production at ambient temperature in the open is expected to be minimal, as the material is generally wet. However, depending on oil content and conditions, it is possible flammable vapors could accumulate in the headspace of storage containers, presenting a flammability and explosion hazard. Being heavier than air, vapors may travel long distances to an ignition source and flash back. Runoff to sewer may cause fire or explosion hazard.

SECTION 6. ACCIDENTAL RELEASE MEASURES

Personal precautions : Evacuate nonessential personnel and remove or secure all ignition sources. Consider wind direction; stay upwind and uphill, if possible. Evaluate the direction of product travel, diking, sewers, etc. to contain spill areas.

Environmental precautions : Carefully contain and stop the source of the spill, if safe to do so. Protect bodies of water by diking, absorbents, or absorbent boom, if possible. Do not flush down sewer or drainage systems, unless system is designed and permitted to handle such material.

Methods for cleaning up : Take up with sand or oil absorbing materials. Carefully vacuum, shovel, scoop or sweep up into a waste container for reclamation or disposal.

SECTION 7. HANDLING AND STORAGE

Precautions for safe handling : Keep away from fire, sparks and heated surfaces. No smoking near areas where

material is stored or handled. The product should only be stored and handled in areas with intrinsically safe electrical classification.

Hydrocarbon liquids including this product can act as a non-conductive flammable liquid (or static accumulators), and may form ignitable vapor-air mixtures in storage tanks or other containers. Precautions to prevent static-initated fire or explosion during transfer, storage or handling, include but are not limited to these examples:

(1) Ground and bond containers during product transfers. Grounding and bonding may not be adequate protection to prevent ignition or explosion of hydrocarbon liquids and vapors that are static accumulators.
(2) Special slow load procedures for "switch loading" must be followed to avoid the static ignition hazard that can exist when higher flash point material (such as fuel oil or diesel) is loaded into tanks previously containing low flash point products (such gasoline or naphtha).
(3) Storage tank level floats must be effectively bonded.

For more information on precautions to prevent static-initated fire or explosion, see NFPA 77, Recommended Practice on Static Electricity (2007), and API Recommended Practice 2003, Protection Against Ignitions Arising Out of Static, Lightning, and Stray Currents (2008).

Conditions for storage, including any incompatabilities : Keep away from flame, sparks, excessive temperatures and open flame. Use approved containers. Keep containers closed and clearly labeled. Empty or partially full product containers or vessels may contain explosive vapors. Do not pressurize, cut, heat, weld or expose containers to sources of ignition. Store in a well-ventilated area. The storage area should comply with NFPA 30 "Flammable and Combustible Liquid Code". The cleaning of tanks previously containing this product should follow API Recommended Practice (RP) 2013 "Cleaning Mobile Tanks In Flammable and Combustible Liquid Service" and API RP 2015 "Cleaning Petroleum Storage Tanks".

Hydrogen sulfide may accumulate in tanks and bulk transport compartments. Consider appropriate respiratory protection (see Section 8). Stand upwind. Avoid vapors when opening hatches and dome covers. Confined spaces should be ventilated and gas tested prior to entry.

Keep away from food, drink and animal feed. Incompatible with oxidizing agents. Incompatible with acids.

No decomposition if stored and applied as directed.

SECTION 8. EXPOSURE CONTROLS / PERSONAL PROTECTION

Exposure Guidelines

List	Components	CAS-No.	Type:	Value
OSHA	Polycyclic aromatic compounds (or coal tar pitch volatiles – benzene soluble)		PEL	0.2 mg/m3
	Clarified oils (petroleum), catalytic cracked; Heavy Fuel oil	64741-62-4	PEL	5 mg/m3 (as mineral oil mist)
	Hydrogen Sulfide	7783-06-4	STEL	20 ppm
ACGIH	Hydrogen Sulfide	7783-06-4	TWA	1 ppm
		7783-06-4	STEL	5 ppm

	Clarified oils (petroleum), catalytic cracked; Heavy Fuel oil	64741-62-4	TWA	0.2 mg/m3 (as mineral oil) Sum of 15 NTP-listed polynuclear aromatic hydrocarbons 0.005 mg/m3
	Polycyclic aromatic compounds (or coal tar pitch volatiles – benzene soluble)		TWA	0.2 mg/m3

Engineering measures : Use adequate ventilation to keep gas and vapor concentrations of this product below occupational exposure and flammability limits, particularly in confined spaces.

Eye protection : Safety glasses or goggles are recommended where there is a possibility of splashing or spraying.

Hand protection : Gloves constructed of nitrile, neoprene, or PVC are recommended.

Skin and body protection : Chemical protective clothing such as DuPont Tyvek QC, TyChem® or equivalent, recommended based on degree of exposure. The resistance of specific material may vary from product to product as well as with degree of exposure.

Respiratory protection : If hydrogen sulfide concentration may exceed permissible exposure limit, a positive-pressure SCBA or Type C supplied air respirator with escape bottle is required as respiratory protection. If hydrogen sulfide concentration is below H2S permissible exposure limit a NIOSH/ MSHA-approved air-purifying respirator with acid gas cartridges may be acceptable for odor control, but continuous air monitoring for H2S is recommended. Protection provided by air-purifying respirators is limited. Use a NIOSH/ MSHA-approved positive-pressure supplied-air respirator if there is a potential for uncontrolled release, exposure levels are not known, in oxygen-deficient atmospheres, or any other circumstance where an air-purifying respirator may not provide adequate protection. Refer to OSHA 29 CFR 1910.134, ANSI Z88.2-1992, NIOSH Respirator Decision Logic, and the manufacturer for additional guidance on respiratory protection selection.

Work / Hygiene practices : Emergency eye wash capability should be available in the near proximity to operations presenting a potential splash exposure. Use good personal hygiene practices. Avoid repeated and/or prolonged skin exposure. Wash hands before eating, drinking, smoking, or using toilet facilities. Do not use as a cleaning solvent on the skin. Do not use solvents or harsh abrasive skin cleaners for washing this product from exposed skin areas. Waterless hand cleaners are effective. Promptly remove contaminated clothing and launder before reuse. Use care when laundering to prevent the formation of flammable vapors which could ignite via washer or dryer. Consider the need to discard contaminated leather shoes and gloves.

SECTION 9. PHYSICAL AND CHEMICAL PROPERTIES

Appearance Dark green to brown or black liquid

Odor Petroleum asphalt odor

Odor threshold	No data available
pH	Not applicable
Melting point/freezing point	32° - 80°C (89.6° - 176°F)
Initial boiling point & range	154 - 372 °C (310° - 702 °F)
Flash point	60°C (140°F) minimum
Evaporation rate	Higher initially and declining as lighter components evaporate
Flammability (solid, gas)	Flammable vapor released by heated liquid
Upper explosive limit	No data available
Lower explosive limit	No data available
Vapor pressure	210 Pa at 25°C
Vapor density (air = 1)	>5
Relative density (water = 1)	>0.9 to 1.2 g/mL
Solubility (in water)	6 to 1400 mg/L at 25°C
Partition coefficient (n-octanol/water)	3.4 to 5 as log Pow at 25°C
Auto-ignition temperature	>176°C (>350 °F)
Decomposition temperature	Will evaporate or boil and possibly ignite before decomposition occurs.
Kinematic viscosity	>300 cST typical at 40°C

SECTION 10. STABILITY AND REACTIVITY

Reactivity	:	Vapors may form explosive mixtures with air. Hazardous polymerization does not occur.
Chemical Stability		Stable under normal conditions.
Possibility of hazardous reactions		Can react with strong oxidizing agents and peroxides. Keep away from strong acids and bases.
Conditions to avoid		Avoid high temperatures, open flames, sparks, welding, smoking and other ignition sources. Keep away from strong oxidizers.
Hazardous decomposition products		Carbon monoxide, carbon dioxide and noncombusted hydrocarbons (smoke).

SECTION 11. TOXICOLOGICAL INFORMATION

Inhalation	:	Because of its low vapor pressure, this product presents a minimal inhalation hazard at ambient temperature. Upon heating, fumes may be evolved. Inhalation of fumes or mist may result in respiratory tract irritation and central nervous system (brain) effects may include headache, dizziness, loss of balance and coordination, unconsciousness, coma, respiratory failure, and death. The burning of any hydrocarbon as a fuel in an area without adequate ventilation may result in hazardous levels of combustion products, including carbon monoxide, and inadequate oxygen levels, which may cause unconsciousness, suffocation, and death. Irritating and toxic hydrogen sulfide gas may be present. Greater than 15 - 20 ppm continuous exposure can cause mucous membrane and respiratory tract

irritation. 50 - 500 ppm can cause headache, nausea, and dizziness. Continued exposure at these levels can lead to loss of reasoning and balance, difficulty in breathing, fluid in the lungs, and possible loss of consciousness. Greater than 500 ppm can cause rapid unconsciousness due to respiratory paralysis and death by suffocation unless the victim is removed from exposure and successfully resuscitated. Greater than 1000 ppm can cause immediate unconsciousness and death if not promptly revived. After-effects from overexposure are not anticipated except what would be expected if the victim was without oxygen for more than 3 to 5 minutes (asphyxiation). The "rotten egg" odor of hydrogen sulfide is not a reliable indicator for warning of exposure, since olfactory fatigue (loss of smell) readily occurs, especially at concentrations above 50 ppm. At high concentrations, the victim may not even recognize the odor before becoming unconscious.

Skin irritation

May cause skin irritation with prolonged or repeated contact. Practically non-toxic if absorbed following acute (single) exposure. Exposure may cause a phototoxicity reaction: liquid or mist on the skin may produce a painful sunburn reaction when exposed to sunlight. Product may be hot which could cause 1st, 2nd, or 3rd degree thermal burns.

Eye irritation

May cause irritation, experienced as mild discomfort and seen as slight excess redness of the eye.

Ingestion

This material has a low order of acute toxicity. If large quantities are ingested, nausea, vomiting and diarrhea may result. Ingestion may also cause effects similar to inhalation of the product. Could present an aspiration hazard if liquid is inhaled into lungs, particularly from vomiting after ingestion. Aspiration may result in chemical pneumonia, severe lung damage, respiratory failure and even death.

Further information

This material contains polynuclear aromatic hydrocarbons (PNAs), some of which are animal carcinogens. Studies have shown that similar products produce skin cancer or skin tumors in laboratory animals following repeated applications without washing or removal. The significance of this finding to human exposure has not been determined. Other studies with active skin carcinogens have shown that washing the animal's skin with soap and water between applications reduced tumor formation. The presence of carcinogenic PNAs indicates that precautions should be taken to minimize repeated and prolonged inhalation of fumes or mists. Dermal application of gas oil to rats resulted in limited evidence of liver damage (i.e., increased liver weight and changes in hepatic serum enzyme activity) and bone marrow toxicity (hypoplasia and decreased hemoglobin.) Petroleum industry experience indicates that a program providing for good personal hygiene, proper use of personal protective equipment, and minimizing the repeated and prolonged exposure to liquids and fumes, is effective in reducing or eliminating the carcinogenic risk of high boiling aromatic oils (polynuclear aromatic hydrocarbons) to humans.
Liver and kidney injuries may occur.
Components of the product may affect the nervous system.

Component:

Clarified oils (petroleum), catalytic cracked; Heavy Fuel oil	64741-62-4	Acute oral toxicity: LD50 rat Dose: 4,320 mg/kg Acute dermal toxicity: LD50 rabbit Dose: 2,001 mg/kg Skin irritation: Classification: Irritating to skin. Result: Mild skin irritation Eye irritation: Classification: Irritating to eyes. Result: Mild eye irritation

Carcinogenicity: Animal experiments showed a statistically significant number of tumors.

Carcinogenicity

NTP	Benzo[a]pyrene; Benzo[def]chrysene (CAS-No.: 50-32-8)
IARC	Benzo[a]pyrene; Benzo[def]chrysene (CAS-No.: 50-32-8)
OSHA	No component of this product present at levels greater than or equal to 0.1% is identified as a carcinogen or potential carcinogen by OSHA.
CA Prop 65	WARNING! This product contains a chemical known to the State of California to cause cancer. Benzo[a]pyrene; Benzo[def]chrysene (CAS-No.: 50-32-8)

SECTION 12. ECOLOGICAL INFORMATION

Additional ecological information : Keep out of sewers, drainage areas, and waterways. Report spills and releases, as applicable, under Federal and State regulations.

SECTION 13. DISPOSAL CONSIDERATIONS

Disposal : Consult federal, state and local waste regulations to determine appropriate waste characterization of material and allowable disposal methods.

SECTION 14. TRANSPORT INFORMATION

CFR

Proper shipping name	:	Not regulated if shipped below 140°F (60°C) Elevated temperature liquid, flammable (if shipped above 140°F (60°C)).
UN-No.	:	Not regulated if shipped below 140°F (60°C) 3256 if shipped above 140°F (60°C)
Class	:	9
Packing group	:	III
Hazard inducer	:	(Clarified oils (petroleum), catalytic cracked; Heavy Fuel oil)

TDG

Proper shipping name	:	Not regulated if shipped below 140°F (60°C) Elevated temperature liquid, flammable (if shipped above 140°F (60°C)).
UN-No.	:	Not regulated if shipped below 140°F (60°C) 3256 if shipped above 140°F (60°C)
Class	:	9
Packing group	:	III
Hazard inducer	:	(Clarified oils (petroleum), catalytic cracked; Heavy Fuel oil)

IATA Cargo Transport

UN-No.	:	Not regulated if shipped below 140°F (60°C) 3256 if shipped above 140°F (60°C)
Class	:	Not regulated if shipped below 140°F (60°c) Not permitted for transport (at 140°F (60°C) or higher temperature) 9

IATA Passenger Transport

UN-No.	:	Not regulated if shipped below 140°F (60°C) 3256 if shipped above 140°F (60°C)
Class	:	Not regulated if shipped below 140°F (60°c) Not permitted for transport (at 140°F (60°C) or higher temperature) 9

IMDG-Code

UN-No.	:	Not regulated if shipped below 140°F (60°C) 3256 if shipped above 140°F (60°C)
Description of the goods	:	Elevated temperature liquid, n.o.s. (Clarified oils (petroleum), catalytic cracked; Heavy Fuel oil)
Class	:	Not regulated if shipped below 140°F (60°c) Not permitted for transport (at 140°F (60°C) or higher temperature) 9
Packaging group	:	III
IMDG-Labels	:	9
EmS Number	:	F-A S-P
Marine pollutant	:	No

SECTION 15. REGULATORY INFORMATION

CERCLA SECTION 103 and SARA SECTION 304 (RELEASE TO THE ENVIROMENT)

The CERCLA definition of hazardous substances contains a "petroleum exclusion" clause which exempts crude oil. Fractions of crude oil, and products (both finished and intermediate) from the crude oil refining process and any indigenous components of such from the CERCLA Section 103 reporting requirements. However, other federal reporting requirements, including SARA Section 304, as well as the Clean Water Act may still apply.

TSCA Status	:	On TSCA Inventory
DSL Status	:	All components of this product are on the Canadian DSL list.
SARA 311/312 Hazards	:	Fire Hazard Acute Health Hazard Chronic Health Hazard

SARA III — US. EPA Emergency Planning and Community Right-To-Know Act (EPCRA) SARA Title III Section 313 Toxic Chemicals (40 CFR 372.65) - Supplier Notification Required

Components	CAS-No.
Benzo[a]pyrene; Benzo[def]chrysene	50-32-8

SARA III — US. EPA Emergency Planning and Community Right-To-Know Act (EPCRA) SARA Title III Section 302 Extremely Hazardous Substance (40 CFR355, Appendix A)

Components	CAS-No.

PENN RTK — US. Pennsylvania Worker and Community Right-to-Know Law (34 Pa. Code Chap. 301-323)

Components	CAS-No.
Clarified oils (petroleum), catalytic cracked; Heavy Fuel oil	64741-62-4
Benzo[a]pyrene; Benzo[def]chrysene	50-32-8

MASS RTK — US. Massachusetts Commonwealth's Right-to-Know Law (Appendix A to 105 Code of Massachusetts Regulations Section 670.000)

Components	CAS-No.
Benzo[a]pyrene; Benzo[def]chrysene	50-32-8

NJ RTK US. New Jersey Worker and Community Right-to-Know Act (New Jersey Statute Annotated Section 34:5A-5)

Components	CAS-No.
Clarified oils (petroleum), catalytic cracked; Heavy Fuel oil	64741-62-4
Benzo[a]pyrene; Benzo[def]chrysene	50-32-8

California Prop. 65 : WARNING! This product contains a chemical known in the State of California to cause cancer.

Benzo[a]pyrene; Benzo[def]chrysene	50-32-8

SECTION 16. OTHER INFORMATION


Further information

The information provided in this Safety Data Sheet is correct to the best of our knowledge, information and belief at the date of its publication. The information given is designed only as guidance for safe handling, use, processing, storage, transportation, disposal and release and is not to be considered a warranty or quality specification. The information relates only to the specific material designated and may not be valid for such material used in combination with any other materials or in any process, unless specified in the text.

Revision Date : 07/26/2012

65, 66, 121, 295, 296, 347, 1003, 1006, 1007, 1009, 1010, 1022, 1054, 1083, 1084, 1085, 1089, 1586, 1886



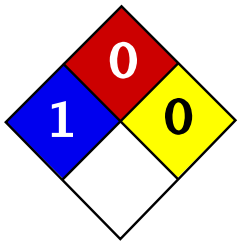

Health	1
Fire	0
Reactivity	0
Personal Protection	E

Material Safety Data Sheet
Lead MSDS

Section 1: Chemical Product and Company Identification

Product Name: Lead

Catalog Codes: SLL1291, SLL1669, SLL1081, SLL1459, SLL1834

CAS#: 7439-92-1

RTECS: OF7525000

TSCA: TSCA 8(b) inventory: Lead

CI#: Not available.

Synonym: Lead Metal, granular; Lead Metal, foil; Lead Metal, sheet; Lead Metal, shot

Chemical Name: Lead

Chemical Formula: Pb

Contact Information:

Sciencelab.com, Inc.
14025 Smith Rd.
Houston, Texas 77396

US Sales: **1-800-901-7247**
International Sales: **1-281-441-4400**

Order Online: ScienceLab.com

CHEMTREC (24HR Emergency Telephone), call: 1-800-424-9300

International CHEMTREC, call: 1-703-527-3887

For non-emergency assistance, call: 1-281-441-4400

Section 2: Composition and Information on Ingredients

Composition:

Name	CAS #	% by Weight
Lead	7439-92-1	100

Toxicological Data on Ingredients: Lead LD50: Not available. LC50: Not available.

Section 3: Hazards Identification

Potential Acute Health Effects: Slightly hazardous in case of skin contact (irritant), of eye contact (irritant), of ingestion, of inhalation.

Potential Chronic Health Effects:
Slightly hazardous in case of skin contact (permeator).
CARCINOGENIC EFFECTS: Classified A3 (Proven for animal.) by ACGIH, 2B (Possible for human.) by IARC.
MUTAGENIC EFFECTS: Not available.
TERATOGENIC EFFECTS: Not available.
DEVELOPMENTAL TOXICITY: Not available.
The substance may be toxic to blood, kidneys, central nervous system (CNS).
Repeated or prolonged exposure to the substance can produce target organs damage.

Section 4: First Aid Measures

Eye Contact:
Check for and remove any contact lenses. In case of contact, immediately flush eyes with plenty of water for at least 15 minutes. Get medical attention if irritation occurs.

Skin Contact: Wash with soap and water. Cover the irritated skin with an emollient. Get medical attention if irritation develops.

Serious Skin Contact: Not available.

Inhalation:
If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention.

Serious Inhalation: Not available.

Ingestion:
Do NOT induce vomiting unless directed to do so by medical personnel. Never give anything by mouth to an unconscious person. If large quantities of this material are swallowed, call a physician immediately. Loosen tight clothing such as a collar, tie, belt or waistband.

Serious Ingestion: Not available.

Section 5: Fire and Explosion Data

Flammability of the Product: May be combustible at high temperature.

Auto-Ignition Temperature: Not available.

Flash Points: Not available.

Flammable Limits: Not available.

Products of Combustion: Some metallic oxides.

Fire Hazards in Presence of Various Substances: Non-flammable in presence of open flames and sparks, of shocks, of heat.

Explosion Hazards in Presence of Various Substances:
Risks of explosion of the product in presence of mechanical impact: Not available.
Risks of explosion of the product in presence of static discharge: Not available.

Fire Fighting Media and Instructions:
SMALL FIRE: Use DRY chemical powder.
LARGE FIRE: Use water spray, fog or foam. Do not use water jet.

Special Remarks on Fire Hazards: When heated to decomposition it emits highly toxic fumes of lead.

Special Remarks on Explosion Hazards: Not available.

Section 6: Accidental Release Measures

Small Spill:
Use appropriate tools to put the spilled solid in a convenient waste disposal container. Finish cleaning by spreading water on the contaminated surface and dispose of according to local and regional authority requirements.

Large Spill:
Use a shovel to put the material into a convenient waste disposal container. Finish cleaning by spreading water on the contaminated surface and allow to evacuate through the sanitary system. Be careful that the product is not

present at a concentration level above TLV. Check TLV on the MSDS and with local authorities.

Section 7: Handling and Storage

Precautions:
Keep locked up.. Keep away from heat. Keep away from sources of ignition. Empty containers pose a fire risk, evaporate the residue under a fume hood. Ground all equipment containing material. Do not ingest. Do not breathe dust. Wear suitable protective clothing. If ingested, seek medical advice immediately and show the container or the label. Keep away from incompatibles such as oxidizing agents.

Storage: Keep container tightly closed. Keep container in a cool, well-ventilated area.

Section 8: Exposure Controls/Personal Protection

Engineering Controls:
Use process enclosures, local exhaust ventilation, or other engineering controls to keep airborne levels below recommended exposure limits. If user operations generate dust, fume or mist, use ventilation to keep exposure to airborne contaminants below the exposure limit.

Personal Protection: Safety glasses. Lab coat. Dust respirator. Be sure to use an approved/certified respirator or equivalent. Gloves.

Personal Protection in Case of a Large Spill:
Splash goggles. Full suit. Dust respirator. Boots. Gloves. A self contained breathing apparatus should be used to avoid inhalation of the product. Suggested protective clothing might not be sufficient; consult a specialist BEFORE handling this product.

Exposure Limits:
TWA: 0.05 (mg/m3) from ACGIH (TLV) [United States]
TWA: 0.05 (mg/m3) from OSHA (PEL) [United States]
TWA: 0.03 (mg/m3) from NIOSH [United States]
TWA: 0.05 (mg/m3) [Canada]Consult local authorities for acceptable exposure limits.

Section 9: Physical and Chemical Properties

Physical state and appearance: Solid. (Metal solid.)

Odor: Not available.

Taste: Not available.

Molecular Weight: 207.21 g/mole

Color: Bluish-white. Silvery. Gray

pH (1% soln/water): Not applicable.

Boiling Point: 1740°C (3164°F)

Melting Point: 327.43°C (621.4°F)

Critical Temperature: Not available.

Specific Gravity: 11.3 (Water = 1)

Vapor Pressure: Not applicable.

Vapor Density: Not available.

Volatility: Not available.

Odor Threshold: Not available.

Water/Oil Dist. Coeff.: Not available.

Ionicity (in Water): Not available.

Dispersion Properties: Not available.

Solubility: Insoluble in cold water.

Section 10: Stability and Reactivity Data

Stability: The product is stable.

Instability Temperature: Not available.

Conditions of Instability: Incompatible materials, excess heat

Incompatibility with various substances: Reactive with oxidizing agents.

Corrosivity: Non-corrosive in presence of glass.

Special Remarks on Reactivity:
Can react vigorously with oxidizing materials.
Incompatible with sodium carbide, chlorine trifluoride, trioxane + hydrogen peroxide, ammonium nitrate, sodium azide, disodium acetylide, sodium acetylide, hot concentrated nitric acid, hot concentrated hydrochloric acid, hot concentrated sulfuric acid, zirconium.

Special Remarks on Corrosivity: Not available.

Polymerization: Will not occur.

Section 11: Toxicological Information

Routes of Entry: Absorbed through skin. Inhalation. Ingestion.

Toxicity to Animals:
LD50: Not available.
LC50: Not available.

Chronic Effects on Humans:
CARCINOGENIC EFFECTS: Classified A3 (Proven for animal.) by ACGIH, 2B (Possible for human.) by IARC.
May cause damage to the following organs: blood, kidneys, central nervous system (CNS).

Other Toxic Effects on Humans: Slightly hazardous in case of skin contact (irritant), of ingestion, of inhalation.

Special Remarks on Toxicity to Animals: Not available.

Special Remarks on Chronic Effects on Humans: Not available.

Special Remarks on other Toxic Effects on Humans:
Acute Potential:
Skin:
Lead metal granules or dust: May cause skin irritation by mechanical action.
Lead metal foil, shot or sheets: Not likely to cause skin irritation
Eyes:
Lead metal granules or dust: Can irritate eyes by mechanical action.

Lead metal foil, shot or sheets: No hazard. Will not cause eye irritation.
Inhalation:
In an industrial setting, exposure to lead mainly occurs from inhalation of dust or fumes.
Lead dust or fumes: Can irritate the upper respiratory tract (nose, throat) as well as the bronchi and lungsby mechanical action. Lead dust can be absorbed through the respiratory system. However, inhaled lead does not accumulate in the lungs. All of an inhaled dose is eventually abssorbed or transferred to the gastrointestinal tract. Inhalation effects of exposure to fumes or dust of inorganic lead may not develop quickly. Symptoms may include metallic taste, chest pain, decreased physical fitness, fatigue, sleep disturbance, headache, irritability, reduces memory, mood and personality changes, aching bones and muscles, constipation, abdominal pains, decreasing appetite. Inhalation of large amounts may lead to ataxia, deliriuim, convulsions/seizures, coma, and death.
Lead metal foil, shot, or sheets: Not an inhalation hazard unless metal is heated. If metal is heated, fumes will be released. Inhalation of these fumes may cause "fume metal fever", which is characterized by flu-like symptoms. Symptoms may include metallic taste, fever, nausea, vomiting, chills, cough, weakness, chest pain, generalized muscle pain/aches, and increased white blood cell count.
Ingestion:
Lead metal granules or dust: The symptoms of lead poisoning include abdominal pain or cramps (lead cholic), spasms, nausea, vomiting, headache, muscle weakness, hallucinations, distorted perceptions, "lead line" on the gums, metallic taste, loss of appetite, insomnia, dizziness and other symptoms similar to that of inhalation. Acute poisoning may result in high lead levels in the blood and urine, shock, coma and death in extreme cases.
Lead metal foil, shot or sheets: Not an ingestion hazard for usual industrial handling.

Section 12: Ecological Information

Ecotoxicity: Not available.

BOD5 and COD: Not available.

Products of Biodegradation:
Possibly hazardous short term degradation products are not likely. However, long term degradation products may arise.

Toxicity of the Products of Biodegradation: The products of degradation are less toxic than the product itself.

Special Remarks on the Products of Biodegradation: Not available.

Section 13: Disposal Considerations

Waste Disposal:
Waste must be disposed of in accordance with federal, state and local environmental control regulations.

Section 14: Transport Information

DOT Classification: Not a DOT controlled material (United States).

Identification: Not applicable.

Special Provisions for Transport: Not applicable.

Section 15: Other Regulatory Information

Federal and State Regulations:
California prop. 65: This product contains the following ingredients for which the State of California has found to cause cancer, birth defects or other reproductive harm, which would require a warning under the statute: Lead
California prop. 65: This product contains the following ingredients for which the State of California has found to cause reproductive harm (female) which would require a warning under the statute: Lead
California prop. 65: This product contains the following ingredients for which the State of California has found to

cause reproductive harm (male) which would require a warning under the statute: Lead
California prop. 65 (no significant risk level): Lead: 0.0005 mg/day (value)
California prop. 65: This product contains the following ingredients for which the State of California has found to cause birth defects which would require a warning under the statute: Lead
California prop. 65: This product contains the following ingredients for which the State of California has found to cause cancer which would require a warning under the statute: Lead
Connecticut hazardous material survey.: Lead
Illinois toxic substances disclosure to employee act: Lead
Illinois chemical safety act: Lead
New York release reporting list: Lead
Rhode Island RTK hazardous substances: Lead
Pennsylvania RTK: Lead

Other Regulations:
OSHA: Hazardous by definition of Hazard Communication Standard (29 CFR 1910.1200).
EINECS: This product is on the European Inventory of Existing Commercial Chemical Substances.

Other Classifications:

WHMIS (Canada): CLASS D-2A: Material causing other toxic effects (VERY TOXIC).

DSCL (EEC):
R20/22- Harmful by inhalation and if swallowed.
R33- Danger of cumulative effects.
R61- May cause harm to the unborn child.
R62- Possible risk of impaired fertility.
S36/37- Wear suitable protective clothing and gloves.
S44- If you feel unwell, seek medical advice (show the label when possible).
S53- Avoid exposure - obtain special instructions before use.

HMIS (U.S.A.):

Health Hazard: 1

Fire Hazard: 0

Reactivity: 0

Personal Protection: E

National Fire Protection Association (U.S.A.):

Health: 1

Flammability: 0

Reactivity: 0

Specific hazard:

Protective Equipment:
Gloves.
Lab coat.
Dust respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate.

Safety glasses.

Section 16: Other Information

References: Not available.


Other Special Considerations: Not available.

Created: 10/10/2005 08:21 PM

Last Updated: 11/06/2008 12:00 PM

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no event shall ScienceLab.com be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if ScienceLab.com has been advised of the possibility of such damages.



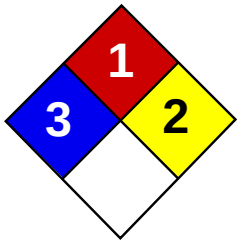



Material Safety Data Sheet
Arsenic MSDS

Section 1: Chemical Product and Company Identification

Product Name: Arsenic

Catalog Codes: SLA1006

CAS#: 7440-38-2

RTECS: CG0525000

TSCA: TSCA 8(b) inventory: Arsenic

CI#: Not applicable.

Synonym:

Chemical Name: Arsenic

Chemical Formula: As

Contact Information:

Sciencelab.com, Inc.
14025 Smith Rd.
Houston, Texas 77396

US Sales: **1-800-901-7247**
International Sales: **1-281-441-4400**

Order Online: ScienceLab.com

CHEMTREC (24HR Emergency Telephone), call:
1-800-424-9300

International CHEMTREC, call: 1-703-527-3887

For non-emergency assistance, call: 1-281-441-4400

Section 2: Composition and Information on Ingredients

Composition:

Name	CAS #	% by Weight
Arsenic	7440-38-2	100

Toxicological Data on Ingredients: Arsenic: ORAL (LD50): Acute: 763 mg/kg [Rat]. 145 mg/kg [Mouse].

Section 3: Hazards Identification

Potential Acute Health Effects:
Very hazardous in case of ingestion, of inhalation. Slightly hazardous in case of skin contact (irritant), of eye contact (irritant).

Potential Chronic Health Effects:
CARCINOGENIC EFFECTS: Classified A1 (Confirmed for human.) by ACGIH. MUTAGENIC EFFECTS: Not available. TERATOGENIC EFFECTS: Not available. DEVELOPMENTAL TOXICITY: Not available. The substance is toxic to kidneys, lungs, the nervous system, mucous membranes. Repeated or prolonged exposure to the substance can produce target organs damage.

Section 4: First Aid Measures

Eye Contact:
Check for and remove any contact lenses. In case of contact, immediately flush eyes with plenty of water for at least 15 minutes. Get medical attention if irritation occurs.

Skin Contact: Wash with soap and water. Cover the irritated skin with an emollient. Get medical attention if irritation develops.

Serious Skin Contact: Not available.

Inhalation:
If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get medical attention.

Serious Inhalation:
Evacuate the victim to a safe area as soon as possible. Loosen tight clothing such as a collar, tie, belt or waistband. If breathing is difficult, administer oxygen. If the victim is not breathing, perform mouth-to-mouth resuscitation. Seek medical attention.

Ingestion:
Do NOT induce vomiting unless directed to do so by medical personnel. Never give anything by mouth to an unconscious person. If large quantities of this material are swallowed, call a physician immediately. Loosen tight clothing such as a collar, tie, belt or waistband.

Serious Ingestion: Not available.

Section 5: Fire and Explosion Data

Flammability of the Product: May be combustible at high temperature.

Auto-Ignition Temperature: Not available.

Flash Points: Not available.

Flammable Limits: Not available.

Products of Combustion: Some metallic oxides.

Fire Hazards in Presence of Various Substances: Flammable in presence of open flames and sparks, of heat, of oxidizing materials.

Explosion Hazards in Presence of Various Substances:
Risks of explosion of the product in presence of mechanical impact: Not available. Risks of explosion of the product in presence of static discharge: Not available.

Fire Fighting Media and Instructions:
SMALL FIRE: Use DRY chemical powder. LARGE FIRE: Use water spray, fog or foam. Do not use water jet.

Special Remarks on Fire Hazards:
Material in powder form, capable of creating a dust explosion. When heated to decomposition it emits highly toxic fumes.

Special Remarks on Explosion Hazards: Not available.

Section 6: Accidental Release Measures

Small Spill: Use appropriate tools to put the spilled solid in a convenient waste disposal container.

Large Spill:
Use a shovel to put the material into a convenient waste disposal container. Be careful that the product is not present at a concentration level above TLV. Check TLV on the MSDS and with local authorities.

Section 7: Handling and Storage

Precautions:
Keep locked up.. Keep away from heat. Keep away from sources of ignition. Empty containers pose a fire risk, evaporate the residue under a fume hood. Ground all equipment containing material. Do not ingest. Do not breathe dust. Wear suitable

protective clothing. In case of insufficient ventilation, wear suitable respiratory equipment. If ingested, seek medical advice immediately and show the container or the label. Keep away from incompatibles such as oxidizing agents, acids, moisture.

Storage: Keep container tightly closed. Keep container in a cool, well-ventilated area.

Section 8: Exposure Controls/Personal Protection

Engineering Controls:
Use process enclosures, local exhaust ventilation, or other engineering controls to keep airborne levels below recommended exposure limits. If user operations generate dust, fume or mist, use ventilation to keep exposure to airborne contaminants below the exposure limit.

Personal Protection: Safety glasses. Lab coat. Dust respirator. Be sure to use an approved/certified respirator or equivalent. Gloves.

Personal Protection in Case of a Large Spill:
Splash goggles. Full suit. Dust respirator. Boots. Gloves. A self contained breathing apparatus should be used to avoid inhalation of the product. Suggested protective clothing might not be sufficient; consult a specialist BEFORE handling this product.

Exposure Limits:
TWA: 0.01 from ACGIH (TLV) [United States] [1995] Consult local authorities for acceptable exposure limits.

Section 9: Physical and Chemical Properties

Physical state and appearance: Solid. (Lustrous solid.)

Odor: Not available.

Taste: Not available.

Molecular Weight: 74.92 g/mole

Color: Silvery.

pH (1% soln/water): Not applicable.

Boiling Point: Not available.

Melting Point: Sublimation temperature: 615°C (1139°F)

Critical Temperature: Not available.

Specific Gravity: 5.72 (Water = 1)

Vapor Pressure: Not applicable.

Vapor Density: Not available.

Volatility: Not available.

Odor Threshold: Not available.

Water/Oil Dist. Coeff.: Not available.

Ionicity (in Water): Not available.

Dispersion Properties: Not available.

Solubility: Insoluble in cold water, hot water.

Section 10: Stability and Reactivity Data

Stability: The product is stable.

Instability Temperature: Not available.

Conditions of Instability: Not available.

Incompatibility with various substances: Reactive with oxidizing agents, acids, moisture.

Corrosivity: Non-corrosive in presence of glass.

Special Remarks on Reactivity: Not available.

Special Remarks on Corrosivity: Not available.

Polymerization: Will not occur.

Section 11: Toxicological Information

Routes of Entry: Inhalation. Ingestion.

Toxicity to Animals: Acute oral toxicity (LD50): 145 mg/kg [Mouse].

Chronic Effects on Humans:
CARCINOGENIC EFFECTS: Classified A1 (Confirmed for human.) by ACGIH. Causes damage to the following organs: kidneys, lungs, the nervous system, mucous membranes.

Other Toxic Effects on Humans:
Very hazardous in case of ingestion, of inhalation. Slightly hazardous in case of skin contact (irritant).

Special Remarks on Toxicity to Animals: Not available.

Special Remarks on Chronic Effects on Humans: Not available.

Special Remarks on other Toxic Effects on Humans: Not available.

Section 12: Ecological Information

Ecotoxicity: Not available.

BOD5 and COD: Not available.

Products of Biodegradation:
Possibly hazardous short term degradation products are not likely. However, long term degradation products may arise.

Toxicity of the Products of Biodegradation: The products of degradation are as toxic as the original product.

Special Remarks on the Products of Biodegradation: Not available.

Section 13: Disposal Considerations

Waste Disposal:

Section 14: Transport Information

DOT Classification: CLASS 6.1: Poisonous material.

Identification: : Arsenic UNNA: UN1558 PG: II

Special Provisions for Transport: Not available.

Section 15: Other Regulatory Information

Federal and State Regulations:
California prop. 65: This product contains the following ingredients for which the State of California has found to cause cancer, birth defects or other reproductive harm, which would require a warning under the statute: Arsenic California prop. 65: This product contains the following ingredients for which the State of California has found to cause cancer which would require a warning under the statute: Arsenic Pennsylvania RTK: Arsenic Massachusetts RTK: Arsenic TSCA 8(b) inventory: Arsenic

Other Regulations: OSHA: Hazardous by definition of Hazard Communication Standard (29 CFR 1910.1200).

Other Classifications:

WHMIS (Canada):
CLASS D-1A: Material causing immediate and serious toxic effects (VERY TOXIC). CLASS D-2A: Material causing other toxic effects (VERY TOXIC).

DSCL (EEC):
R22- Harmful if swallowed. R45- May cause cancer.

HMIS (U.S.A.):

Health Hazard: 3

Fire Hazard: 1

Reactivity: 2

Personal Protection: E

National Fire Protection Association (U.S.A.):

Health: 3

Flammability: 1

Reactivity: 2

Specific hazard:

Protective Equipment:
Gloves. Lab coat. Dust respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate. Safety glasses.

Section 16: Other Information

References:
-Hawley, G.G.. The Condensed Chemical Dictionary, 11e ed., New York N.Y., Van Nostrand Reinold, 1987. -Liste des produits purs tératogènes, mutagènes, cancérogènes. Répertoire toxicologique de la Commission de la Santé et de la Sécurité du Travail du Québec. -Material safety data sheet emitted by: la Commission de la Santé et de la Sécurité du Travail du Québec. -SAX, N.I. Dangerous Properties of Indutrial Materials. Toronto, Van Nostrand Reinold, 6e ed. 1984. -The Sigma-Aldrich Library of Chemical Safety Data, Edition II. -Guide de la loi et du règlement sur le transport des marchandises dangeureuses au canada. Centre de conformité internatinal Ltée. 1986.


Other Special Considerations: Not available.

Created: 10/09/2005 04:16 PM

Last Updated: 11/06/2008 12:00 PM

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no event shall ScienceLab.com be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if ScienceLab.com has been advised of the possibility of such damages.



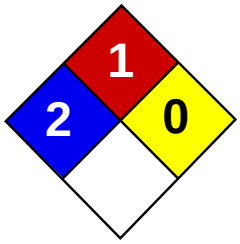



Material Safety Data Sheet
Copper MSDS

Section 1: Chemical Product and Company Identification

Product Name: Copper

Catalog Codes: SLC4939, SLC2152, SLC3943, SLC1150, SLC2941, SLC4729, SLC1936, SLC3727, SLC5515

CAS#: 7440-50-8

RTECS: GL5325000

TSCA: TSCA 8(b) inventory: Copper

CI#: Not available.

Synonym:

Chemical Name: Not available.

Chemical Formula: Cu

Contact Information:

Sciencelab.com, Inc.
14025 Smith Rd.
Houston, Texas 77396

US Sales: **1-800-901-7247**
International Sales: **1-281-441-4400**

Order Online: ScienceLab.com

CHEMTREC (24HR Emergency Telephone), call: 1-800-424-9300

International CHEMTREC, call: 1-703-527-3887

For non-emergency assistance, call: 1-281-441-4400

Section 2: Composition and Information on Ingredients

Composition:

Name	CAS #	% by Weight
Copper	7440-50-8	100

Toxicological Data on Ingredients: Copper LD50: Not available. LC50: Not available.

Section 3: Hazards Identification

Potential Acute Health Effects:
Very hazardous in case of ingestion. Hazardous in case of eye contact (irritant), of inhalation. Slightly hazardous in case of skin contact (irritant).

Potential Chronic Health Effects:
CARCINOGENIC EFFECTS: Not available. MUTAGENIC EFFECTS: Not available. TERATOGENIC EFFECTS: Not available. DEVELOPMENTAL TOXICITY: Not available. The substance is toxic to lungs, mucous membranes. Repeated or prolonged exposure to the substance can produce target organs damage.

Section 4: First Aid Measures

Eye Contact: Check for and remove any contact lenses. Do not use an eye ointment. Seek medical attention.

Skin Contact:
After contact with skin, wash immediately with plenty of water. Gently and thoroughly wash the contaminated skin with running water and non-abrasive soap. Be particularly careful to clean folds, crevices, creases and groin. Cover the irritated skin with an emollient. If irritation persists, seek medical attention. Wash contaminated clothing before reusing.

Serious Skin Contact: Not available.

Inhalation: Allow the victim to rest in a well ventilated area. Seek immediate medical attention.

Serious Inhalation: Not available.

Ingestion:
Do not induce vomiting. Loosen tight clothing such as a collar, tie, belt or waistband. If the victim is not breathing, perform mouth-to-mouth resuscitation. Seek immediate medical attention.

Serious Ingestion: Not available.

Section 5: Fire and Explosion Data

Flammability of the Product: May be combustible at high temperature.

Auto-Ignition Temperature: Not available.

Flash Points: Not available.

Flammable Limits: Not available.

Products of Combustion: Some metallic oxides.

Fire Hazards in Presence of Various Substances: Not available.

Explosion Hazards in Presence of Various Substances:
Risks of explosion of the product in presence of mechanical impact: Not available. Risks of explosion of the product in presence of static discharge: Not available.

Fire Fighting Media and Instructions:
SMALL FIRE: Use DRY chemical powder. LARGE FIRE: Use water spray, fog or foam. Do not use water jet.

Special Remarks on Fire Hazards: Not available.

Special Remarks on Explosion Hazards: Not available.

Section 6: Accidental Release Measures

Small Spill:
Use appropriate tools to put the spilled solid in a convenient waste disposal container. Finish cleaning by spreading water on the contaminated surface and dispose of according to local and regional authority requirements.

Large Spill:
Use a shovel to put the material into a convenient waste disposal container. Finish cleaning by spreading water on the contaminated surface and allow to evacuate through the sanitary system. Be careful that the product is not present at a concentration level above TLV. Check TLV on the MSDS and with local authorities.

Section 7: Handling and Storage

Precautions:
Keep away from heat. Keep away from sources of ignition. Empty containers pose a fire risk, evaporate the residue under a fume hood. Ground all equipment containing material. Do not breathe dust. Avoid contact with eyes Wear suitable protective clothing In case of insufficient ventilation, wear suitable respiratory equipment If you feel unwell, seek medical attention and show the label when possible.

Storage:
Keep container dry. Keep in a cool place. Ground all equipment containing material. Keep container tightly closed. Keep in a cool, well-ventilated place. Combustible materials should be stored away from extreme heat and away from strong oxidizing agents.

Section 8: Exposure Controls/Personal Protection

Engineering Controls:
Use process enclosures, local exhaust ventilation, or other engineering controls to keep airborne levels below recommended exposure limits. If user operations generate dust, fume or mist, use ventilation to keep exposure to airborne contaminants below the exposure limit.

Personal Protection:
Splash goggles. Lab coat. Dust respirator. Be sure to use an approved/certified respirator or equivalent. Gloves.

Personal Protection in Case of a Large Spill:
Splash goggles. Full suit. Dust respirator. Boots. Gloves. A self contained breathing apparatus should be used to avoid inhalation of the product. Suggested protective clothing might not be sufficient; consult a specialist BEFORE handling this product.

Exposure Limits:
TWA: 1 (mg/m3) from ACGIH [1990] Consult local authorities for acceptable exposure limits.

Section 9: Physical and Chemical Properties

Physical state and appearance: Solid.

Odor: Not available.

Taste: Not available.

Molecular Weight: 63.54 g/mole

Color: Not available.

pH (1% soln/water): Not applicable.

Boiling Point: 2595°C (4703°F)

Melting Point: 1083°C (1981.4°F)

Critical Temperature: Not available.

Specific Gravity: 8.94 (Water = 1)

Vapor Pressure: Not applicable.

Vapor Density: Not available.

Volatility: Not available.

Odor Threshold: Not available.

Water/Oil Dist. Coeff.: Not available.

Ionicity (in Water): Not available.

Dispersion Properties: Not available.

Solubility: Insoluble in cold water.

Section 10: Stability and Reactivity Data

Stability: The product is stable.

Instability Temperature: Not available.

Conditions of Instability: Not available.

Incompatibility with various substances: Not available.

Corrosivity: Non-corrosive in presence of glass.

Special Remarks on Reactivity: Not available.

Special Remarks on Corrosivity: Not available.

Polymerization: No.

Section 11: Toxicological Information

Routes of Entry: Absorbed through skin. Eye contact. Inhalation. Ingestion.

Toxicity to Animals:
LD50: Not available. LC50: Not available.

Chronic Effects on Humans: The substance is toxic to lungs, mucous membranes.

Other Toxic Effects on Humans:
Very hazardous in case of ingestion. Hazardous in case of inhalation. Slightly hazardous in case of skin contact (irritant).

Special Remarks on Toxicity to Animals: Not available.

Special Remarks on Chronic Effects on Humans: Human: passes through the placenta, excreted in maternal milk.

Special Remarks on other Toxic Effects on Humans: Not available.

Section 12: Ecological Information

Ecotoxicity: Not available.

BOD5 and COD: Not available.

Products of Biodegradation:
Possibly hazardous short term degradation products are not likely. However, long term degradation products may arise.

Toxicity of the Products of Biodegradation: The products of degradation are as toxic as the original product.

Special Remarks on the Products of Biodegradation: Not available.

Section 13: Disposal Considerations

Waste Disposal:

Section 14: Transport Information

DOT Classification: Not a DOT controlled material (United States).

Identification: Not applicable.

Special Provisions for Transport: Marine Pollutant

Section 15: Other Regulatory Information

Federal and State Regulations:
Pennsylvania RTK: Copper Massachusetts RTK: Copper TSCA 8(b) inventory: Copper CERCLA: Hazardous substances.: Copper

Other Regulations: OSHA: Hazardous by definition of Hazard Communication Standard (29 CFR 1910.1200).

Other Classifications:

WHMIS (Canada): CLASS D-2A: Material causing other toxic effects (VERY TOXIC).

DSCL (EEC): R36- Irritating to eyes.

HMIS (U.S.A.):

Health Hazard: 2

Fire Hazard: 1

Reactivity: 0

Personal Protection: E

National Fire Protection Association (U.S.A.):

Health: 2

Flammability: 1

Reactivity: 0

Specific hazard:

Protective Equipment:
Gloves. Lab coat. Dust respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate. Splash goggles.

Section 16: Other Information

References: Not available.

Other Special Considerations: Not available.

Created: 10/09/2005 04:58 PM

Last Updated: 11/06/2008 12:00 PM

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no event shall ScienceLab.com be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if ScienceLab.com has been advised of the possibility of such damages.

MATERIAL SAFETY DATA SHEET

Date Printed: 05/17/2006
Date Updated: 01/28/2006
Version 1.4

Section 1 - Product and Company Information

Product Name	10.00 G ZINC FIXANAL AS ZINC SULFATE
Product Number	38950
Brand	RIEDEL
Company	Sigma-Aldrich
Address	3050 Spruce Street SAINT LOUIS MO 63103 US
Technical Phone:	800-325-5832
Fax:	800-325-5052
Emergency Phone:	314-776-6555

Section 2 - Composition/Information on Ingredient

Substance Name	CAS #	SARA 313
ZINC STANDARD CONCENTRATE	None	No

Ingredient Name	CAS #	Percent	SARA 313
WATER	7732-18-5	84	No
ZINC SULFATE HEPTAHYDRATE	7446-20-0	16	Yes

Section 3 - Hazards Identification

EMERGENCY OVERVIEW

Dangerous for the environment. Harmful.
Harmful if swallowed. Irritating to eyes and skin. Toxic to aquatic organisms, may cause long-term adverse effects in the aquatic environment.
Target organ(s): Liver. Kidneys.

HMIS RATING

HEALTH: 2*
FLAMMABILITY: 0
REACTIVITY: 0

NFPA RATING

HEALTH: 2
FLAMMABILITY: 0
REACTIVITY: 0

*additional chronic hazards present.

For additional information on toxicity, please refer to Section 11.

Section 4 - First Aid Measures

ORAL EXPOSURE

If swallowed, wash out mouth with water provided person is conscious. Call a physician.

INHALATION EXPOSURE

If inhaled, remove to fresh air. If breathing becomes difficult,

call a physician.

DERMAL EXPOSURE
In case of contact, immediately wash skin with soap and copious amounts of water.

EYE EXPOSURE
In case of contact with eyes, flush with copious amounts of water for at least 15 minutes. Assure adequate flushing by separating the eyelids with fingers. Call a physician.

Section 5 - Fire Fighting Measures

FLASH POINT
N/A

AUTOIGNITION TEMP
N/A

FLAMMABILITY
N/A

EXTINGUISHING MEDIA
Suitable: Water spray. Carbon dioxide, dry chemical powder, or appropriate foam.

FIREFIGHTING
Protective Equipment: Wear self-contained breathing apparatus and protective clothing to prevent contact with skin and eyes.
Specific Hazard(s): Emits toxic fumes under fire conditions.

Section 6 - Accidental Release Measures

METHODS FOR CLEANING UP
Absorb on sand or vermiculite and place in closed containers for disposal. Ventilate area and wash spill site after material pickup is complete.

Section 7 - Handling and Storage

HANDLING
User Exposure: Avoid inhalation. Avoid contact with eyes, skin, and clothing. Avoid prolonged or repeated exposure.

STORAGE
Suitable: Keep tightly closed.

Section 8 - Exposure Controls / PPE

ENGINEERING CONTROLS
Safety shower and eye bath. Mechanical exhaust required.

PERSONAL PROTECTIVE EQUIPMENT
Respiratory: Use respirators and components tested and approved under appropriate government standards such as NIOSH (US) or CEN (EU). Respiratory protection is not required. Where protection is desired, use multi-purpose combination (US) or type ABEK (EN 14387) respirator cartridges.
Hand: Protective gloves.
Eye: Chemical safety goggles.

GENERAL HYGIENE MEASURES

Wash thoroughly after handling.

Section 9 - Physical/Chemical Properties

Appearance Physical State: Liquid

Property	Value	At Temperature or Pressure
pH	N/A	
BP/BP Range	N/A	
MP/MP Range	N/A	
Freezing Point	N/A	
Vapor Pressure	N/A	
Vapor Density	N/A	
Saturated Vapor Conc.	N/A	
SG/Density	N/A	
Bulk Density	N/A	
Odor Threshold	N/A	
Volatile%	N/A	
VOC Content	N/A	
Water Content	N/A	
Solvent Content	N/A	
Evaporation Rate	N/A	
Viscosity	N/A	
Surface Tension	N/A	
Partition Coefficient	N/A	
Decomposition Temp.	N/A	
Flash Point	N/A	
Explosion Limits	N/A	
Flammability	N/A	
Autoignition Temp	N/A	
Refractive Index	N/A	
Optical Rotation	N/A	
Miscellaneous Data	N/A	
Solubility	N/A	

N/A = not available

Section 10 - Stability and Reactivity

STABILITY
Stable: Stable.
Materials to Avoid: Strong oxidizing agents.

HAZARDOUS DECOMPOSITION PRODUCTS
Hazardous Decomposition Products: Zinc/zinc oxides, Sulfur oxides.

HAZARDOUS POLYMERIZATION
Hazardous Polymerization: Will not occur

Section 11 - Toxicological Information

ROUTE OF EXPOSURE
Skin Contact: May cause skin irritation.
Skin Absorption: May be harmful if absorbed through the skin.
Eye Contact: May cause eye irritation.
Inhalation: May be harmful if inhaled. Material may be irritating to mucous membranes and upper respiratory tract.
Ingestion: May be harmful if swallowed.

TARGET ORGAN(S) OR SYSTEM(S)
Kidneys. Pancreas. Liver. Lungs.

SIGNS AND SYMPTOMS OF EXPOSURE
To the best of our knowledge, the chemical, physical, and toxicological properties have not been thoroughly investigated.

Section 12 - Ecological Information

No data available.

Section 13 - Disposal Considerations

APPROPRIATE METHOD OF DISPOSAL OF SUBSTANCE OR PREPARATION
Contact a licensed professional waste disposal service to dispose of this material. Dissolve or mix the material with a combustible solvent and burn in a chemical incinerator equipped with an afterburner and scrubber. Observe all federal, state, and local environmental regulations.

Section 14 - Transport Information

DOT
Proper Shipping Name: Environmentally hazardous substances, liquid, n.o.s.
UN#: 3082
Class: 9
Packing Group: Packing Group III
Hazard Label: Class 9
PIH: Not PIH

IATA
Proper Shipping Name: Environmentally hazardous substance, liquid, n.o.s.
IATA UN Number: 3082
Hazard Class: 9
Packing Group: III

Section 15 - Regulatory Information

EU ADDITIONAL CLASSIFICATION
Symbol of Danger: Xi-N
Indication of Danger: Irritant. Dangerous for the environment.
R: 41-50/53
Risk Statements: Risk of serious damage to eyes. Very toxic to aquatic organisms, may cause long-term adverse effects in the aquatic environment.
S: 26-39-61
Safety Statements: In case of contact with eyes, rinse immediately with plenty of water and seek medical advice. Wear eye/face protection. Avoid release to the environment. Refer to special instructions/safety data sheets.

US CLASSIFICATION AND LABEL TEXT
Indication of Danger: Dangerous for the environment. Harmful.
Risk Statements: Harmful if swallowed. Irritating to eyes and skin. Toxic to aquatic organisms, may cause long-term adverse effects in the aquatic environment.
Safety Statements: Avoid contact with eyes. Wear suitable protective clothing. Avoid release to the environment. Refer to special instructions/safety data sheets.
US Statements: Target organ(s): Liver. Kidneys.

UNITED STATES REGULATORY INFORMATION

SARA LISTED: No

CANADA REGULATORY INFORMATION
WHMIS Classification: This product has been classified in accordance with the hazard criteria of the CPR, and the MSDS contains all the information required by the CPR.
DSL: No
NDSL: No

Section 16 - Other Information

DISCLAIMER
For R&D use only. Not for drug, household or other uses.

WARRANTY
The above information is believed to be correct but does not purport to be all inclusive and shall be used only as a guide. The information in this document is based on the present state of our knowledge and is applicable to the product with regard to appropriate safety precautions. It does not represent any guarantee of the properties of the product. Sigma-Aldrich Inc., shall not be held liable for any damage resulting from handling or from contact with the above product. See reverse side of invoice or packing slip for additional terms and conditions of sale.
Copyright 2006 Sigma-Aldrich Co. License granted to make unlimited paper copies for internal use only.

APPENDIX C

Heat Illness Prevention Program

HEAT ILLNESS
PREVENTION PROGRAM

CORPORATE HEALTH AND SAFETY DIRECTOR	:	**Brian Hobbs, CIH, CSP**
EFFECTIVE DATE	:	**10/2019**
REVISION DATE	:	**03/2025**
REVISION NUMBER	:	**4**

TABLE OF CONTENTS

1. PURPOSE 1

2. SCOPE AND APPLICABILITY 1

3. ROLES AND RESPONSIBILITIES 1

4. HAZARD IDENTIFICATION AND ASSESSMENT 2

5. TRAINING 2

6. DRINKING WATER 3

7. ACCESS TO SHADE 4

8. MONITORING AND SCHEDULING 5

9. ACCLIMATIZATION AND NEW EMPLOYEE PROCEDURES 5

10. HEAT WAVE AND EXTREME HEAT PROCEDURES 5

11. EMERGENCY RESPONSE PROCEDURES 6

12. HEAT-RELATED ILLNESSES 6

13. OTHER HEAT CONTROLS 8

1. PURPOSE

Roux Associates, Inc. and its affiliated companies, Roux Environmental Engineering and Geology, D.P.C, and Remedial Engineering (collectively, "Roux"), have established this heat illness prevention program to assist in preventing workplace accidents, injuries, and illnesses associated with temperature extremes. Roux is committed to taking every precaution to protect employees who might be exposed to heat stress, including establishing safe work practices, heat illness prevention controls, and emergency preparedness, which will be detailed in this plan.

2. SCOPE AND APPLICABILITY

Roux's Heat Illness Prevention Program applies to all employees and subcontractors who may be exposed to heat stress in the field.

3. ROLES AND RESPONSIBILITIES

The Heat Illness Prevention Program Administrator for Roux is the Corporate Health and Safety Director (CHSD), Brian Hobbs, CIH, CSP. The daily administration of the program is delegated to the Operations Manager (OM) , Office Health and Safety Manager (OHSM), and Site Health and Safety Officer (SHSO). The CHSD has the authority, responsibility, and overall accountability for the comprehensive implementation of this program.

All managers and supervisors shall implement and maintain the heat illness prevention program in work areas where there is a potential for heat stress.

Management Responsibilities

Management (i.e., Project Managers, Project Principals, OM) must provide the following to promote compliance and foster a good safety culture:

- Comply with applicable standards.
- Inform employees of the provisions of the heat illness prevention program and ensure understanding.
- Provide sufficient water, shade, rest areas, and other heat illness controls for employees.
- Assist with establishing work practices to minimize heat stress risks, such as acclimatization, required rest periods, employee monitoring, and strategic scheduling.
- Encourage employees to report hazardous conditions or heat illness symptoms.
- Provide training to any employee who could possibly be exposed to the risk of heat illness.

Employee Responsibilities

Employees are expected to actively participate in the organization's heat illness prevention program, which includes the following responsibilities:

- Receive appropriate training with regard to heat stress.
- Understand core concepts of heat illness prevention and follow guidelines to mitigate risks.
- Recognize the signs and symptoms of heat illness and immediately report them.
- Cooperate with workplace inspections and incident investigations.

Effective Communication

All Roux employees shall be accountable for ensuring there is effective communication with both the field team and their subcontractors. Communication between Roux employees, project leads (e.g., Project Principal, Project

Managers), and subcontractors (if applicable) will be established and maintained so that employees can quickly contact should there be a change in condition or someone at the Site exhibits signs/symptoms of heat stress. These types of incidents would follow Roux's Incident Investigation and Reporting Management Program 2.12 and Roux's Injury Illness Prevention Program 2.22.

4. HAZARD IDENTIFICATION AND ASSESSMENT

Prior to scheduled fieldwork, the project team shall ensure a hazard assessment is conducted as it relates to heat stress. This will include a determination of how much heat and exertion employees are likely to be exposed to based on the work activity.

Factors that can increase heat stress include the following:

- Temperatures at the work site;
- Humidity;
- A lack of air movement or exchange;
- The amount of time employees spend working in the heat;
- The time of day work takes place;
- Sources of radiant heat (e.g., sunlight, fire, or hot furnace);
- Work activities that produce heat (e.g., welding);
- Physical contact with warm or hot objects or liquids;
- The clothing and PPE employees are required to wear; and/or
- Physically strenuous work.

Results of the hazard analysis should be used to determine appropriate controls for mitigating heat stress, whenever possible, for planning acclimatization, and for developing work schedules that rotate workers to limit employee exposure. Typically, the Site Supervisor (SS) or Site Health and Safety Officer (SHSO) shall conduct worksite observations to ensure all employees follow heat illness prevention procedures and that hazards are sufficiently controlled. However, all employees should be continuously evaluating work site conditions and be able to recognize heat stressors in order to prevent heat illnesses.

5. TRAINING

All Roux employees shall be trained on the topics listed below prior to beginning work, which may potentially expose workers to heat stress.

Training Topics

- The environmental, behavioral, and personal risk factors for heat illness, such as radiant heat sources, exertion, clothing and PPE, and use of alcohol or drugs.
- Types of heat illnesses, common symptoms, and appropriate emergency response for each.
- The knowledge that mild symptoms may quickly become more severe or life-threatening.
- The importance of immediately reporting any signs or symptoms of heat illness to the supervisor.
- The employer's responsibility to provide shade, water, access to first aid, and cool-down rests during work and the employee's freedom to exercise their rights under this standard without fear of retaliation.

- The employer's heat stress plan and its procedures:
  - Procedures for employees who are newly assigned to work in high-heat areas.
  - The organization's acclimatization methods, as applicable.
  - Heatwave procedures.
  - Heat illness and emergency response, including contact information.
- The importance of frequent consumption of water and the taking of rest breaks.
- How heat illness prevention applies to employees' specific tasks.

Increasing Training Effectiveness:

- The SS/SHSO will hold daily tailgates with the field team to go over daily work tasks and basic safety information, including Job Safety Analysis (JSA) review, as well as incorporate elements such as current weather and effects on the work activities for the day.
- If a heat wave or high heat is anticipated, OHSMs and/or OMs will provide communications to Roux employees prior to their shifts and remind them of any special high heat procedures.

6. DRINKING WATER

Employees shall be given access to potable drinking water. Access to water will be provided as near as possible to where employees are working, and there shall be enough locations so employees will have sufficient water. Water should be fresh and pure, free of taste or smell that would discourage employees from drinking, comfortably cool, and obtained from an approved source.

The recommendation is that during warm or hot weather, employees drink four 8-ounce glasses of water, or a total of one quart per hour, throughout the entire work shift. Easy access to sufficient potable drinking water throughout the work shift encourages employees to drink.

During a heat wave, water shall be replenished more often to keep it available and cool. Water containers (and all spouts and levers) must be kept clean. If able, provide single-use drinking cups with appropriate waste receptacles. Accessible sanitation facilities shall also be maintained at work Sites as appropriate.

SS/SHSO is responsible for the following:

- Drink sufficient water before, during, and after work shifts to maintain hydration.
- Encourage frequent drinking of small amounts of water throughout the shift. In high-heat environments, remind field staff and subcontractors that drinking extra water may be necessary.
- Discourage the choice of drinks with caffeine or sugar that may possibly dehydrate employees instead of water. Also, discourage the drinking of alcohol.
- Monitor the water supply.
- If employees become dehydrated and are unable to alleviate symptoms with the steps below, get them immediate medical attention.

Field Staff/Subcontractors are responsible for the following:

- Drink sufficient water before, during, and after work shifts to maintain hydration. Drink up to 4 cups of water per hour, especially during hot weather.
- Be aware that in high-heat situations, you may need to drink more water.

- Monitor yourself and others for signs of dehydration. If you feel dehydrated:
  - Follow Roux's Incident Notification Flowchart;
  - Rest in the shaded resting area; and
  - Drink water in small amounts, but frequently.

7. ACCESS TO SHADE

Access to shaded areas will be provided to Roux staff, as needed. Employees are encouraged to use these areas when they feel overheated. Roux's SS/SHSO shall oversee the proper implementation of shaded areas and will communicate these locations on a daily basis with the Field Team.

Depending on the Site, shaded areas can include the following:

- Pop-up Tents
- Canopies
- Umbrellas
- Structures mechanically ventilated or open to air movement
  - Garage
- Conex-mounted RV canopies
- Full and thick tree canopies that block direct sunlight
- Buildings
- Enclosed areas only if they provide cooling comparable to shade in open-air
  - Vehicles with air conditioning

Shaded Area Requirements

The shade shall be strong enough to cool employees down and other shadows should not be visible in the shade. The shade will be provided by Roux when the air temperature exceeds 80°F. If the temperature is less than 80°F, shade will be available and provided upon request. The SS/SHSO will monitor conditions to determine when the air will exceed (and is exceeding) 80°F. For most Sites, air will be monitored hourly and shade will be set up immediately if 80°F is exceeded.

Shade shall be located as close as practical to areas where employees are working and is easily accessible. These areas will be considered safe and free from other hazards. Shaded areas should be large enough to accommodate all employees who are on a break, resting, or recovering without crowding. Should natural vegetation be used for shade, the SS/SHSO will evaluate shade for effectiveness.

Field Staff Responsibilities

Field Staff should take ordinary rest breaks in the shaded areas and monitor themselves for signs of heat stress, and go to the shaded area when they need to cool down. Any issues or problems with shaded areas should be reported to the SS/SHSO for the Site.

If shaded areas are used for a preventative cool-down, the SS/SHSO will ensure the affected employees will remain in the shade until they begin to feel better. The SS/SHSO will continue to monitor the employees and ask them if

they are experiencing symptoms of a heat illness. Employees shall not be sent back to work before symptoms have ended and at a minimum at least 10 minutes of rest.

8. MONITORING AND SCHEDULING

Monitoring

The SS/SHSO and Field Team will continue to monitor themselves and others for signs of heat illness. The SS/SHSO will monitor when the air temperature exceeds 80°F. Throughout the summer, weather and temperature will be monitored at least two weeks ahead, and the work schedule will be planned to accommodate the expected weather.

Scheduling

Scheduling accommodations may include:

- Working during cooler hours of the day
- Working at night
- Stopping work early
- Rescheduling work activities
- Increasing frequency of breaks

In general, strenuous work activities shall be rescheduled to the coolest parts of the day.

Special precautions are required for temperatures above 80°F, 95°F, and heat waves. These precautions are provided in the sections below.

9. ACCLIMATIZATION AND NEW EMPLOYEE PROCEDURES

Roux requires employees to be acclimatized in order for them to better tolerate heat in the workplace. Acclimatization is the physical process of adapting to a different thermal environment, allowing a better toleration of heat. Acclimatization procedures require gradual exposure that gives the employee time to adjust to each level of exposure. Acclimatization is essential for new employees but is necessary for all employees when the temperature significantly changes. Heat stress is much more likely if these procedures are not followed.

The SS/SHSO is responsible for observing new employees during their first 14 days of employment in high-heat areas.

Re-acclimatization is necessary if employees are absent from high-heat environments for a week or more or the temperature increases significantly.

10. HEATWAVE AND EXTREME HEAT PROCEDURES

Heat Wave Procedures

A heat wave is defined as consistent temperatures over 80°F or if the temperature is 10° higher than the average daily temperatures in the preceding 5 days.

SS/SHSO and Project Management (e.g., PP, PM) shall closely observe and monitor employees during a heat wave. The Field Teams should institute a ratio of one SS to 20 or fewer employees, a mandatory buddy system, or

a consistent practice for supervisors to check on employees. Pre-shift meetings to review high-heat procedures with employees will be carried out to emphasize work-rest schedules, drinking water, shade, etc.

Extreme Heat Procedures

When work-site temperatures equal or exceed 95°F, the employer will enact extreme heat procedures:

- Employees will be closely observed by the SS/SHSO for signs of heat illness. New employees will be supervised for acclimatization.
- Effective communication and monitoring will be ensured through the use of periodic check-ins via phone with the SS/SHSO. Communications between employees and Project Management (e.g., PP/PM) will be established and maintained. Mandatory 10-minute break periods are required for every two hours worked. SS/SHSO must enforce this rule.
- Pre-shift safety tailgate meetings will occur to review procedures and to remind employees to drink water and take cool-down rests if needed. SS/SHSO shall remind employees to rest and drink water. Employees should drink more water than usual.

11. EMERGENCY RESPONSE PROCEDURES

Roux is dedicated to providing prompt appropriate care for all employees who report or show symptoms of heat illness. If an employee shows signs of heat illness, they will be monitored and shall not be left alone or sent home without being offered first aid or emergency medical services. If on-site personnel require any medical treatment, the following steps will be taken:

1. Notify Roux's Project and Corporate Management Team for any work-related injury and/or illness occurrence, and communicate with the contracted Occupational Health Care Management Provider, AllOne Health (AOH), immediately following the notifications provided above.
2. Based on discussions with the Project Team, Corporate Management, and the AOH evaluation, if medical attention beyond onsite First Aid is warranted, transport the injured/ill person (IP) to the Urgent Care Center, or notify the Fire Department or Ambulance Emergency service and request an ambulance or transport the victim to the hospital, and continue communications with Corporate Management Team. An Urgent Care/Hospital Route map with locations and directions is provided within Site Specific Health and Safety Plans.
3. First aid medical support will be provided by onsite personnel trained and certified in First Aid, Cardio Pulmonary Resuscitation (CPR), Automatic External Defibrillation (AED), and Blood-Borne Pathogens (BBP) Awareness, until relieved by emergency medical services (EMS).
4. The SHSO and Project Manager will perform a Loss Investigation (LI), and the Project Team will complete the final Loss Report.

12. HEAT-RELATED ILLNESSES

Heat Stress

Heat stress is a significant potential hazard and can be associated with heavy physical activity and/or the use of personal protective equipment (PPE) in hot-weather environments. For these reasons, the company will provide potable drinking water and access to shade or other areas of relief (i.e., air-conditioned vehicles and work trailers). Supervisors, prior to supervising personnel in the field as well as all personnel involved with the fieldwork of a project, are trained in this HASP that includes preventing heat-related illnesses and the below procedures in response to heat-related symptoms and illness. Since much of our work is dependent upon environmental factors beyond our control, we must closely monitor air temperature and humidity and be aware of avoiding radiant heat sources and providing as much air circulation as possible wherever we work. Physical factors that need to be evaluated as part of our Job Safety Analysis (JSA) reviews include the level of physical activity and duration of work

and the type (i.e., color, weight breathability) of the clothing we select. In addition, personal factors such as age, weight, fitness, drug/alcohol use, and prior history of heat-related illness need to be considered.

Heat cramps are brought on by prolonged exposure to heat. As an individual sweats, water and salts are lost by the body, resulting in painful muscle cramps. The signs and symptoms of heat stress are as follows:

- Severe muscle cramps, usually in the legs and abdomen;
- Exhaustion, often to the point of collapse; and
- Dizziness or periods of faintness.

First aid treatment includes, but is not limited to, shade, rest, and fluid replacement. Typically, the individual should recover within one-half hour while being monitored constantly. If the individual has not improved substantially within 30 minutes and the body temperature has not decreased, the individual should be transported to a hospital for medical attention.

Heat Exhaustion

Heat exhaustion may occur in a healthy individual who has been exposed to excessive heat while working or exercising. The circulatory system of the individual fails as blood collects near the skin to rid the body of excess heat through transference. The signs and symptoms of heat exhaustion are as follows:

- Rapid and shallow breathing;
- Weak pulse;
- Cold and clammy skin with heavy perspiration;
- Skin appears pale;
- Fatigue and weakness;
- Dizziness; and
- Elevated body temperature.

First aid treatment includes, but is not limited to, cooling the victim, elevating the feet, and replacing fluids. If the individual is not substantially improved within 30 minutes and the body temperature has not decreased, the individual should be transported to the hospital for medical attention.

Heat Stroke

Heat stroke occurs when an individual is exposed to excessive heat and stops sweating. This condition is classified as a MEDICAL EMERGENCY requiring immediate cooling of the victim and transport to a medical facility. The signs and symptoms of heat stroke are as follows:

- Dry, hot red skin;
- Body temperature approaching or above 105 degrees F;
- Confusion, altered mental state, slurred speech;
- Seizures;
- Large (dilated) pupils; and
- Loss of consciousness – the individual may go into a coma.

First aid treatment requires immediate cooling and transportation to a medical facility. Heat stress is a significant hazard if any type of protective equipment (semi-permeable or impermeable) that prevents evaporative cooling is worn in hot-weather environments.

13. OTHER HEAT CONTROLS

Clothing and PPE

Employees should choose clothing that is reflective, light-colored, lightweight, loose-fitting, and breathable. Clothing should cover the exposed parts of the body. In direct sun, hard hats with a brim or bill may be helpful. Should specialized cooling garments be applicable, please consult with your OM/OHSM/CHSD.

Managing Employee Risk Factors

It is recommended that employees are aware of how their health can affect their risk of heat stress. The following increases personnel's risk for a heat-related illness:

- A poor level of physical fitness
- Obesity
- Chronic or acute illnesses
- Conditions such as diabetes, heart disease, or high blood pressure
- Certain medications, such as diuretics
- Age (60+)

Employees should:

- Maintain their health outside of work
- Be aware of the effects of medications
- Drink adequate amounts of water
- Eat light, cool meals during work shifts and save heavy meals until after the shift is over
- Do not skip meals: food helps replace electrolytes when sweating
- Take breaks as needed
- Do not consume alcohol prior to working in a hot environment

APPENDIX D

Personal Protective Equipment (PPE) Management Program

PERSONAL PROTECTIVE EQUIPMENT MANAGEMENT PROGRAM

CORPORATE HEALTH AND SAFETY DIRECTOR	:	**Brian Hobbs, CIH, CSP**
EFFECTIVE DATE	:	**01/2019**
REVIEW DATE	:	**03/2025**
REVISION NUMBER	:	**6**

TABLE OF CONTENTS

1. PURPOSE 1
2. SCOPE AND APPLICABILITY 1
3. PROCEDURES 1
3.1 Introduction 1
3.1.1 Training 1
3.2 Types of PPE 2
3.2.1 PPE Inspection, Cleaning Maintenance, and Storage 2
3.2.1.1 PPE Inspection 2
3.2.1.2 PPE Cleaning and Maintenance 2
3.2.1.3 PPE Storage 3
3.3 Fitting, Donning, and Doffing PPE 3
3.4 Controlling Hazards Associated with PPE Use 4
3.5 PPE Selection 5
3.6 Protective Clothing Selection Criteria 5
3.6.1 Chemicals Present 5
3.6.2 Concentration of the Chemical(s) 5
3.6.3 Physical State 6
3.6.4 Length of Exposure 6
3.6.5 Abrasion 6
3.6.6 Dexterity 6
3.6.7 Ability to Decontaminate 6
3.6.8 Climactic Conditions 7
3.6.9 Work Load 7
3.6.10 Types of Protective Materials 7
3.7 Protection Levels 7
3.7.1 Level A Protection 7
3.7.2 Level B Protection 9
3.7.3 Level C Protection 10
3.7.4 Level D Protection 12
3.7.5 Level E Protection 12
3.7.6 Additional Considerations 13
3.8 Decontamination of PPE 13
3.8.1 Site-Specific Decontamination Plans 14
3.8.2 Emergency Decontamination of PPE 14
3.8.3 Protection of Decontamination Line Assistants 15
3.8.4 Procedures to Minimize PPE Contamination 15
3.8.5 PPE Disposal 16

1. PURPOSE

Roux Associates, Inc. and its affiliated companies, Roux Environmental Engineering and Geology, D.P.C., and Remedial Engineering (collectively, "Roux"), have instituted the following program to establish guidelines for the selection of personal protective equipment (PPE) for use by Roux personnel performing field activities in hazardous environments. PPE is not meant to be a substitute for engineering, work practice, and/or administrative controls, but PPE should be used in conjunction with these controls to protect employees in the workplace. Clothing, body coverings, and other accessories designed to prevent worker exposure to workplace hazards are all types of PPE. To ensure adequate PPE,, employee-owned PPE is assessed on a case-by-case basis to ensure its adequacy, maintenance, and sanitation.

2. SCOPE AND APPLICABILITY

These guidelines apply to all PPE selection decisions to implement the Roux program. The foundations for this program are the numerous Occupational Health and Safety Administration (OSHA) standards related to PPE cited in 29 CFR 1910 Subpart I, 29 CFR 1926 Subpart E, and the hazardous environment work employee protection requirements under the OSHA Hazardous Waste Operations and Emergency Response (HAZWOPER) standard at 29 CFR 1910.120 and 1926.65 as well as California OSHA (Cal/OSHA) Title 8 5192 HAZWOPER. To ensure hazard assessments are documented, the levels of protection, types of protection, and tasks requiring protection are covered in site-specific Health and Safety Plans (HASPs) and Job Safety Analyses (JSAs).

3. PROCEDURES

Due to the varied nature of site activities and the different potential hazards associated with different sites, several aspects must be considered when selecting PPE. The following text describes PPE selection logic and provides guidelines and requirements for the appropriate selection and use of PPE.

3.1 Introduction

To harm the body, chemicals must first gain entrance. The intact skin and respiratory tract are usually the first body tissues that are exposed to chemical contaminants. These tissues provide barriers to some chemicals but, in many cases, are damaged themselves or are highly permeable by certain chemical compounds. PPE, therefore, is used to minimize or eliminate chemical compounds from coming into contact with these first barrier tissues.

Proper PPE selection is essential in preventing exposure. The Project Manager (PM) or health and safety personnel making the selection will have to consider several factors. The level of protection, type, and kind of equipment selected depends on the hazardous conditions. In some cases, additional selection factors include cost, availability, compatibility with other equipment, and performance. All these factors must be accurately assessed before work can be safely carried out.

3.1.1 Training

Training shall be provided to all field-based employees on how to properly use and care for PPE. Training shall include, but not be limited to, the initial 40-hour HAZWOPER training, annual 8-hour HAZWOPER refresher training, and site-specific PPE training. The training program includes when PPE is necessary, what types of PPE are required; how to don, doff, adjust, and wear PPE; the limitations of PPE; the proper care, maintenance, useful life, signs of PPE failure and emergency procedures to follow in the event of PPE failure and disposal of PPE. In addition, retraining shall be conducted when workplace changes require a change in PPE when an employee demonstrates a lack of knowledge or improper use of PPE is identified.

3.2 Types of PPE

The type and selection of PPE must meet certain general criteria and requirements as required under OSHA 29 CFR 1910.132 (General Industry) and 1926.95 (Construction). In addition to these general requirements, specific requirements and specifications exist for some types of PPE that form the basis of the protective clothing scheme. All manufacturer's recommendations for PPE care and use shall be followed. All PPE shall be maintained in a sanitary and reliable condition. Additionally, proper fit and size shall be evaluated to ensure adequate employee protection. Should PPE become defective, it shall be immediately removed from service and discarded.

The following is a list of the common types of specific PPE and the specific requirements for the PPE type, where applicable:

1. Hard Hats - Regulated by 29 CFR 1910.135 and 1926.100; and specified in ANSI Z89.1.
2. Face Shields and Safety Glasses - Regulated by 29 CFR 1910.133 and 1926.102; and specified in ANSI Z87.1.
3. Respiratory Protection - Regulated by 29 CFR 1910.134 and 1926.103.
4. Hand Protection - Regulated by 29 CFR 1910.138
5. Foot Protection - Regulated by 29 CFR 1910.136 and 1926.96; and specified in ANSI Z41.1.
6. Protective Clothing (e.g., fully encapsulated suits, aprons) - Specified in NFPA 1991/1992/1994.

3.2.1 PPE Inspection, Cleaning Maintenance, and Storage

The Office Health and Safety Manager (OHSM) or their designee is responsible for procuring PPE, in accordance with this management program. Single-use/disposable PPE should be purchased and used whenever practicable.

3.2.1.1 PPE Inspection

Roux employees must inspect PPE regularly, before and after each use, to check for defects and damage. Garments and other PPE in central storage must be inspected at least annually or as recommended by the manufacturer by the OHSM, Equipment Manager, and/or their designee. Defective or damaged equipment must be tagged as out-of-service, immediately removed from the work site, and discarded.

3.2.1.2 PPE Cleaning and Maintenance

All Roux employees are responsible for routine cleaning of their assigned PPE. Decontamination of PPE is addressed within Roux's Site Control and Decontamination Program as specified within site-specific health and safety plans. As appropriate, Roux employees should be issued single-use PPE when practicable to minimize the requirement for decontamination. When performing routine cleaning of reusable PPE:

- Always follow the manufacturer's recommendations to avoid damaging the PPE. For example, some cleaning solutions compromise the integrity of protective helmets shell.
- Clean and maintain PPE according to the manufacturer's recommendations. Before being re-issued, PPE should be thoroughly sanitized.
- Disassemble, wash and sanitize reusable respirators after each use. For more information, refer to Roux's Respiratory Protection Management Program.

Employees are not authorized to repair PPE without prior approval from the Health and Safety Department. Reusable PPE may require maintenance by the manufacturer to maintain integrity and certification. Many

manufacturers specify which repairs, if performed by the end-user, will void the product warranty. Therefore, Roux employees are not authorized to perform such maintenance or repairs.

3.2.1.3 PPE Storage

Certain equipment failures can be directly attributed to improper storage. The OHSM or Equipment Manager (or another designated person) is responsible for implementing procedures for appropriate PPE storage, for equipment that is centrally stored. Both central storage and dedicated PPE provided to employees should be stored using the following:

- Store goggles and safety glasses in protective cases.
- Store PPE (such as helmets, boots, etc.) in clean, dust-proof containers or bags out of direct sunlight.
- PPE should ideally be stored under climate-controlled conditions. PPE, stocked gear bags, and/or go-kits should not be stored in hot, cold, or other extreme environmental conditions, and they should not be stored in vehicles (government-owned or rentals) for even short periods of time. Do not store helmets on the rear window shelf of a vehicle.
- Store different kinds of clothing and gloves separately to prevent errors in selection.
- Hang or fold protective clothing in accordance with manufacturers' recommendations.
- Never store contaminated PPE near new protective clothing or street clothing. Potentially contaminated, reusable clothing must be stored (usually bagged) away from new PPE in a well-ventilated area with good airflow around each item until the garment is decontaminated or disposed.
- See Roux's Respiratory Protection Management Program for detailed respirator storage procedures.

3.3 Fitting, Donning, and Doffing PPE

Roux shall provide appropriately sized PPE for Roux employees. Improper fitting such as tight-fitting garments, can tear, especially at the knees, crotch, shoulders, back, and elbows due to movement. Protective clothing that is too large can easily snag and/or limit a user's dexterity. The Roux PM shall ensure site/project-specific PPE is kept in a sufficient stock of appropriately sized PPE (e.g., Level C ensembles). The OHSM, Equipment Manager, and/or their designee shall maintain a sufficient stock of appropriately sized PPE in central storage locations.

The Site Supervisor (SS)/Site Health and Safety Officer (SHSO) is responsible for ensuring that site-specific procedures for donning and doffing PPE are incorporated into site-specific HASPs. Donning and doffing procedures may differ depending on the type of PPE and clothing (e.g., Level D, Modified Level D, Level C) utilized. Site-specific conditions may warrant adjustments to such procedures. Consult the CHSD for additional information. Roux's Site Control & Decontamination Management Program can be referenced for the development of such procedures, which provide additional information on doffing and decontamination procedures related to Level A-D work.

Site-specific donning and doffing procedures should include using an assistant where necessary. Donning and doffing certain types of PPE without assistance could risk failure or damage. Care must be taken to prevent the spread of contaminants on the PPE. Decontamination procedures should limit the potential for cross-contamination and may include gross decontamination of outer boots, gloves, and suits as necessary to prevent contaminants from tracking into the contamination reduction zone (CRZ) and clean zone(s).

3.4 Controlling Hazards Associated with PPE Use

PPE use can pose potential health and safety hazards, which range from minor discomfort to life-threatening height stroke. The magnitude of the potential hazard can vary and will depend on various factors, including an individual's fitness level, the type of PPE worn, the work demands, individual work practices, duration of work, and environmental conditions. The use of PPE can also lead to reduced efficiency and work performance.

Among hazards associated with PPE use, heat stress emerges as a prevalent and significant hazard. Particularly, the use of substantial and/or impermeable attire, such as heavy coveralls, Tyvek suits, splash suits, or Level A or B suits, alongside strenuous work, amplifies the risk of heat stress. Regular monitoring for indications of heat stress is imperative for workers operating in such conditions. Roux's Heat Illness Prevention Program lays out requirements for signs and symptoms as well as preventative measures to mitigate the potential for heat illness. In addition, cold environments can pose adverse risk, such examples include use of non-insulated steel-toe safety shoes in frigid conditions which has the potential to increase the risk of frostbite, while safety gloves worn for chemical protection may inadequately insulate hands from the cold.

It is the responsibility of Project Teams to integrate site-specific protocols to manage PPE hazards into such site-specific HASPs. These protocols can encompass considerations like work/rest ratios, crew rotations, and other accommodations for exceptionally demanding conditions.

The following measures are recommended for controlling hazards posed by PPE use:

- Prioritize through the hierarchy of controls with a focus on elimination, substitution, engineering, work practice and administrative control implementation rather than sole reliance on PPE. PPE shall be considered the last line of worker protection.
- Workers should maintain physical fitness to be able to withstand the potential physical strain of PPE use. A physically fit individual will endure less physiological strain, manifesting in a lower heart rate, reduced body temperature (indicating diminished retained body heat), more effective sweating, slightly lower oxygen consumption, and carbon dioxide production. Furthermore, acclimatization to extreme environmental conditions, such as high temperatures, can influence work performance and physical capacity.
- Understand the symptoms of PPE failure. Workers encountering any of these symptoms while donning PPE should promptly notify their onsite SHSO and/or SS:
    - Perception of odors when wearing a respirator
    - Skin irritation
    - Acute discomfort
    - Difficulty breathing
    - Unusual fatigue
    - Dizziness
    - Inability to see, hear, or speak clearly
    - Uncomfortable restriction of movement
    - Rapid pulse, nausea, or chest pain
- Implement a buddy system. Especially in situations where there is a need for increased level of protection (e.g., Level A-C) workers should work in pairs or teams, and are instructed to monitor the integrity of their team/partners gear and remain alert for symptoms of PPE failure.

3.5 PPE Selection

For site-specific work, the Project Manager, in consultation with the Health and Safety Department, has overall responsibility for coordinating the selection and distribution of PPE to field staff and for ensuring that the selected PPE is appropriate for the site-specific hazards. Generally speaking, Roux employees are not engaged in emergency response or perform work at uncontrolled hazardous waste sites; if this is the case, the CHSD shall be made aware of the work and consult with the Project Team on appropriate PPE selection. Most work falls under environmental sampling of low-concentration contaminants in water/soil/perimeter air. Therefore work is carried out in Level D PPE. Upgrades would be based on more information as it becomes available. The United States Environmental Protection Agency (EPA) has created Guidelines for PPE Ensemble Selection to assist workers in selecting PPE ensembles for specific activities and tasks and determining which ensembles and air monitoring equipment should be used to address specific chemicals. Guidelines to Ensembles for Specific Activities/Tasks Where Chemical Exposure is Possible is provided as a reference in Appendix A.

3.6 Protective Clothing Selection Criteria

3.6.1 Chemicals Present

The most important factor in selecting PPE is the determination of what chemicals the employee may be exposed to. The number of chemicals on field investigations may range from a few to several hundred. The exact chemicals or group of chemicals present at the site (certain groups tend to require similar protection) can be determined by collecting and analyzing air, soil, water, or other site media samples. When data are lacking, research into the hazardous materials used or stored at the site can be used to infer potential chemical exposures on the site.

The most appropriate clothing shall be selected once the known or suspected chemicals have been identified and considered based on the type of work to be performed.

Protective garments are made of several different substances for protection against specific chemicals. There is no universal protective material. All will decompose, permeate, or otherwise fail to protect under given circumstances. Fortunately, most manufacturers make guides to using their products (i.e., Dupont's Tyvek™ Permeation Guide). These guides are usually for gloves and coveralls and typically provide information regarding chemical degradation rates (failure of the material to maintain structural integrity when in contact with the chemical) and may provide information on the permeation rate (whether or not the material allows the chemical to pass through). When permeation tables are available, they shall be used with degradation tables to determine the most appropriate protective material for the specific chemical hazard(s).

During most site work, chemicals are usually in mixed combinations, and the protective materials are not in continuous contact with pure chemicals for long periods; therefore, the selected material may be adequate for the particular chemical of most concern and the type of work being performed, yet not the "best" protecting material for all site chemicals and activities. Selection shall depend upon the most hazardous chemicals based on their hazards and concentrations. Sometimes, layering (i.e., using several layers of protective materials) affords the best protection.

3.6.2 Concentration of the Chemical(s)

One of the major criteria for selecting protective material is the concentration of the chemical(s) in air, liquid, and solid state. Airborne and liquid chemical concentrations should be compared to the OSHA standards, American Conference of Governmental Industrial Hygienists (ACGIH) and National Institute for Occupational Safety and Health (NIOSH) guidelines to determine the level of skin or other absorptive

surface (e.g., eyes) protection needed. While these standards are not designed specifically for skin exposed directly to the liquid, they may provide skin designations indicative of chemicals known to have significant skin or dermal absorption effects. For example, airborne levels of PCBs on-site may be low because they are not very volatile, so the inhalation hazard may be minimal; however, PCB-containing liquid coming in direct contact with the skin may cause overexposure. Thus, PCBs have been assigned a skin designation in the OSHA and ACGIH exposure limit tables.

3.6.3 Physical State

The characteristics of a chemical may range from nontoxic to highly toxic, depending on its physical state. Inorganic lead in soil would not be considered toxic to site personnel unless it became airborne since it is generally not absorbed through the intact skin. However, organic lead in a liquid could be readily absorbed through the skin. Soil is frequently contaminated with hazardous materials. Concentrations will vary from a few parts per million to nearly one hundred percent by volume. The degree of hazard depends on the type of soil and concentration of the chemical. Generally speaking, “dry” soils that have not become airborne do not pose a hazard to site personnel if they take minimal precautions, such as wearing lightweight gloves.

3.6.4 Length of Exposure

The length of time a material is exposed to a chemical increases the probability of a breakthrough. Determinations of actual breakthrough times for short-term exposures indicate that several materials that would be considered inadequate under long-term exposures can be used. Different materials that would be considered inadequate under long-term exposures can be used. It should be kept in mind that during the manufacturer’s permeation testing, a pure (100% composition) liquid is usually placed in direct contact with the material, producing a worst-case situation.

3.6.5 Abrasion

When selecting protective clothing, the job the employee is engaged in must be taken into consideration. Persons moving drums or performing other manual tasks may require added protection for their hands, lower chest, and thighs. Using leather gloves and a heavy apron over other normal protective clothing will help prevent damage to the normal PPE and thus reduce worker exposures.

3.6.6 Dexterity

Although protection from skin and inhalation hazards is the primary concern when selecting PPE, the ability to perform the assigned task must be maintained. For example, personnel cannot be expected to perform work that requires fine dexterity if they must wear thick gloves. Therefore, the PPE selection process must consider the task being performed and provide PPE alternatives or techniques that maintain dexterity while still protecting the worker (e.g., wearing tight latex gloves over more bulky hand protection to increase dexterity).

3.6.7 Ability to Decontaminate

If disposable clothing cannot be used, the ability to decontaminate the materials selected must be taken into consideration. Once a chemical makes contact with the material, the PPE must be cleaned before reusing it. If the chemical has completely permeated the material, the clothing cannot be adequately decontaminated, and the material should be discarded.

3.6.8 Climactic Conditions

The human body works best with few restraints from clothing. Protective clothing adds a body burden by increasing weight, restricting movement, and preventing the body's natural cooling process. In severe situations, a modified work program must be used.

Some materials act differently when they are very hot and very cold. For example, PVC becomes almost brittle in frigid temperatures. If there are any questions about the stability of the protective materials under different conditions, the manufacturer should be contacted before using PPE in the field.

3.6.9 Work Load

Like climactic conditions, the type of work activity may affect work duration and personnel's ability to perform certain tasks. Similarly, the amount of protective materials a person wears will affect their ability to perform certain tasks. For example, a person in a total encapsulating suit, even at 72˚F, cannot work for more than a short period of time without requiring a break.

The work schedule should be adjusted to maintain the health of the employees. Modified work practices may include allowing more time for individual job tasks and implementing work/rest cycles per NIOSH and ACGIH thermal stress recommendations. Special consideration should be given to the selection of clothing that protects the worker and adds the least burden when personnel are required to perform strenuous tasks. Excessive bodily stress frequently represents the most significant hazard encountered during fieldwork.

3.6.10 Types of Protective Materials

1. Cellulose or Paper: suitable for nuisance dust and coarse fibers.
2. Natural and Synthetic Fibers
    a. Tyvek™: suitable small-sized hazardous particles, including lead, asbestos, and mold.
    b. Tychem™: is suitable for a variety of hazards, from light liquid splashes to heavy exposures to industrial chemicals and agents.
    c. Nomex™: is suitable for flame-resistance, radiation resistance, acids, alkalis, fluorocarbon refrigerants (CFCs), and non-polar solvents.
3. Elastomers
    a. Polyethylene: suitable for polar substances and solvents.
    b. Saran™ : suitable for flame-resistance, acids, alkalis, oils, and organic solvents.
    c. Polyvinyl Chloride (PVC): suitable for alcohols, oils, inorganic acids, alkalis, and salts.
    d. Neoprene: suitable for polar/non-polar substances, petroleum mixtures, and ≤ 200 F heat resistance.
    e. Butyl Rubber: suitable for polar substances and solvents.
    f. Viton: suitable for non-polar substances, petroleum mixtures, and ≤ 200 F heat resistance.
    g. Nitrile: suitable for polar/non-polar substances and petroleum mixtures.

3.7 Protection Levels

3.7.1 Level A Protection

Level A protection (a fully encapsulated suit) is used when skin hazards exist or when no known data positively rule out skin and other absorption hazards. Per the Roux Respiratory Protection Management Program, Roux employees are not authorized to enter an IDLH atmosphere; therefore, the program does

not allow supplied air respirators (SARs) or self-contained breathing apparatus (SCBA). At no time will Level A work be performed without the consent of the CHSD and OM.

The following conditions warrant the use of Level A protection:

- Hazardous substances have been identified and require the highest level of protection for skin, eyes, and the respiratory system;
- The atmosphere contains less than 19.5% oxygen or an atmosphere immediately dangerous to life and health (IDLH) that have not been ruled out;
- Site operations involve a high potential for splash, skin immersion, or exposure to suspected skin hazards;
- Direct-reading instruments indicate high levels of unidentified but potentially hazardous vapors or gases in the air (e.g., Total atmospheric readings on the Photoionization Detector (PID), Flame Ionization Detector (FID), and similar instruments indicate 500 to 1,000 ppm of unidentified substances); and
- Direct-reading instruments are not available to test the air and suspected highly toxic substances may be present.

It may be necessary to base the decision to use Level A protection on indirect evidence. Other conditions that may indicate the need for Level A protection include:

- Confined spaces;
- Sites containing known skin hazards;
- Sites with no established history to rule out skin and other absorption hazards;
- Site exhibiting signs of acute mammalian toxicity (e.g., dead animals, illnesses associated with past entry into the site by humans);
- Sites at which sealed drums of unknown materials must be opened;
- Visible indicators such as leaking containers or smoking chemical fires; and
- Extremely hazardous substances (e.g., cyanide compounds, concentrated pesticides, Department of Transportation Poison "A" materials, suspected carcinogens, and infectious substances) are known or suspected to be present, and skin contact is possible.

Table 1: Recommended Level A Ensemble Components

Component	Type	Manufacturer / Recommended Material	Notes
Respirator	Positive-pressure full-facepiece SCBA or positive-pressure supplied-air respirator with escape SCBA[1]	NIOSH approved respirator	See Roux's Respiratory Protection Program. Roux employees are not approved to utilize Supplied Air (SAR) and/or Self-contained breathing apparatus (SCBA).
Suit	Totally encapsulated chemical- and vapor-protective suit	DuPont® Tychem™ or Responder CSM™	Other material types may be substituted based on known contaminants.
Inner Gloves	Lightweight	Nitrile, Neoprene, PVC, or Viton®	Other material types may be substituted based on known contaminants.
Outer Gloves	An integral part of the suit	See Appendix A for additional information	Confirm chemical performance rating for suspected contaminants. Glove material may have different performance ratings than suit material. All fully-encapsulating suit materials must be compatible with substances involved.
Inner Boot	Integral Part of Suit	-	-
Outer Boot	HazMat boot[2]	–	Confirm chemical performance rating of outer boot for suspected contaminants. Provides slip/abrasion resistance.
Hard Hat	Standard[3]	-	-

[1] Must be NIOSH approved.
[2] Must meet NFPA 1991/NFPA 1994 requirements depending on the site hazard assessment.
[3] Must comply with the applicable ANSI standard.

3.7.2 Level B Protection

Level B protection is utilized when the highest level of respiratory protection is needed, but hazardous material exposure to the few unprotected areas of the body is unlikely. At no time will Level B work be performed by Roux personnel without the consent of the CHSD and OM.

The following conditions suggest a need for Level B protection:

- The type and atmospheric concentration of toxic substances have been identified, and they require the highest level of respiratory protection;

- IDLH atmospheres where the substance or concentration in the air does not present a severe skin hazard;
- The type and concentrations of toxic substances do not meet the selection criteria permitting the use of air-purifying respirators and
- It is highly unlikely that the work being done will generate high concentrations of vapors, gases, particulates, or splashes of materials that will affect personnel's skin.

Table 2: Recommended Level B Ensemble Components

Component	Type	Manufacturer / Recommended Material	Notes
Respirator	Positive-pressure full- facepiece SCBA or positive-pressure supplied-air respirator with escape SCBA[1]	NIOSH approved respirator	See Roux's Respiratory Protection Program. Roux employees are not approved to utilize Supplied Air (SAR) and/or Self-contained breathing apparatus (SCBA).
Suit	Chemical-resistant clothing (liquid-splash protective suit with integral boot and hood)[2]	DuPont® Tychem® CPF 3	Other material types may be substituted based on known contaminants.
Inner Gloves	Light/medium weight	Nitrile, Neoprene, PVC, Viton®, or PE/EVAL	Other material types may be substituted based on known contaminants.
Outer Gloves	Medium/heavy weight	Butyl MIL-G12223, Nitrile, Neoprene, PVC, Viton®, PE/EVAL, or heavy weight Nitrile or Neoprene	Confirm chemical performance rating. Other material types may be substituted based on known contaminants.
Inner Boot	Safety work boot	–	Other boot types may be substituted based on known contaminants and physical hazards. Puncture resistant shanks may be required.
Outer Boot	Heavy weight Latex booties or outer boots[2]	Latex booties are used to protect suit for light duty applications. NFPA-rated outer boots may be required based on anticipated site conditions and tasks.	Other outer boot coverings may be substituted based on known contaminants/anticipated tasks.
Hard Hat	Standard[3]	-	-

[1] Must be NIOSH approved.
[2] Must meet NFPA 1991/NFPA 1994 requirements depending on the site hazard assessment.
[3] Must comply with the applicable ANSI standard.

3.7.3 Level C Protection

Level C protection is utilized when skin and respiratory hazards are well defined, and the criteria for using negative pressure respirators have been fulfilled (i.e., known contaminants and contaminant concentrations, acceptable oxygen levels, approved filter/cartridge available, known cartridge service

life, etc.). Level C protection may require an emergency escape respirator during specific initial entry and site reconnaissance situations or when applicable after that.

Table 3: Recommended Level C Ensemble Components

Component	Type	Manufacturer / Recommended Material	Notes
Respirator	Full-face air-purifying respirator with appropriate cartridge[1]	NIOSH approved respirator	See Roux's Respiratory Protection Program for information about the brand, model, acceptable configurations, and specific care instructions for the standard issue respirator. Half-faced respirators may be donned if hazard assessment warrants.
Suit	Puncture/tear resistant suit material with boot and hood[2]	DuPont® Tychem® CPF 2/CPF 3 or Saranex	Other material types may be substituted based on known contaminants, if considered more appropriate.
Inner Gloves	Light weight	Nitrile, Neoprene	Other material types like Neoprene, PVC, Viton®, or PE/EVAL may be substituted based on known contaminants, if considered more appropriate.
Outer Gloves	Medium/heavy weight	Butyl, Nitrile, or other work glove	Confirm chemical performance rating. Other material types may be substituted based on known contaminants, if considered more appropriate.
Inner Boot	Safety work boot	–	Other boot types may be substituted based on known contaminants and physical hazards. Puncture resistant shanks may be required.
Outer Boot	Heavy weight Latex booties or outer boots[2]	Latex booties are used to protect suit for light duty applications. NFPA rated outer boots may be required based on anticipated site conditions and tasks.	Other outer boot coverings may be substituted based on known contaminants.
Hard Hat	Standard[3]	-	-
Eye Protection	Safety glasses/goggles[3],[4]	-	-

1 Must be NIOSH approved.
2 Must meet NFPA 1991/NFPA 1994 requirements depending on the site hazard assessment.
3 Must comply with the applicable ANSI standard.
4 In the case a ½ face respirator is worn eye protection is required.

3.7.4 Level D Protection

Level D is the basic work uniform. Level D is worn when the atmosphere contains no known hazard. Work functions preclude splashes, immersion, potential for inhalation, or direct contact with hazard chemicals. For most Roux field jobs Level D is the standard minimum level of protection worn.

Table 4: Recommended Level D Ensemble Components

Component	Type	Manufacturer / Recommended Material	Notes
Respirator	None	-	-
Suit	Coveralls, street clothes, or disposable Tyvek suit	–	Other types may be substituted as appropriate.
Inner Gloves	N/A		
Outer Gloves	As appropriate for physical hazards and for comfort	–	-
Boot	Safety work boot	–	Roux's standard safety boot is 6", steel/composite safety toe, and electrical hazard (EH) rated.
Outer Boot Covering	As appropriate	–	–
Hard Hat	Standard[3]	-	-
Eye Protection	Safety glasses/goggles[3]	-	-
High Visibility Clothing	High Visibility Vest /Jacket[3]	-	ANSI Class 2 Safety Vests/Jackets are the standard. Class 3 Safety vests/jackets shall be worn in worksites with 50+ MPH traffic.
Hearing Protection	Ear muffs/plugs	-	Workers exposed to excessive noise shall don hearing protection. Refer to Roux's Hearing Conservation Program for more information.

[1] Must be NIOSH approved.
[2] Must meet NFPA 1991/NFPA 1994 requirements depending on the site hazard assessment.
[3] Must comply with the applicable ANSI standard.

3.7.5 Level E Protection

Level E protection is used when radioactivity above 10 millirems per hour (mrems/hr) is detected at the site. Personal protective equipment for Level E includes:

- Coveralls;
- Air purifying respirator (i.e., P100 or equivalent);
- Time limits on exposure;
- Appropriate dermal protection for the type of radiation present, and

- Radiation dosimetry and ambient monitoring.

3.7.6 Additional Considerations

Fieldwork will contain a variety of situations due to chemicals in various concentrations and combinations. These situations may be partially ameliorated by following the work practices listed below:

1. Foot protection is needed on every site. If the ground to be worked on is contaminated with liquid, and it is necessary to walk in the chemicals, some sort of protective shoe coverings or "booties" can be worn over the boots. Shoe coverings should be designed with soles to help prevent slips. Using disposable shoe coverings when contacting liquid contamination can on and reduce overall decontamination requirements. If non-liquids are to be encountered, a Tyvek™ bootie could be used. The advantage of booties is questionable if the ground contains any sharp objects. Boots should be worn with either cotton or wool socks to help absorb perspiration.
2. If the site requires hard hats, chin straps should be used if a person is stooping over where his/her hat may fall off. Respirator straps should not be placed over the hard hats, as this will affect the respirator's fit.

   Some types of protective materials conduct heat and cold readily. In cold conditions, natural material clothing should be worn under protective clothing. Protective clothing should be removed before allowing a person "to get warm." Applying heat, such as with a space heater, to the outside of the protective clothing may drive contaminant permeation. In hot weather, under clothing will absorb sweat. It is recommended that workers use all cotton undergarments.
3. Body protection should be worn and taped to prevent anything from running into the top of the boot. Gloves should be worn and taped to prevent substances from entering the top of the glove. Duct tape is preferred, but masking tape can be used. When aprons are used, they should be taped across the back for added protection. However, this should be done so that the person has mobility.
4. Atmospheric conditions such as precipitation, temperature, wind direction, humidity, wind velocity, and pressure determine the behavior of contaminants in air or the potential for volatile materials to become airborne. These parameters should be considered in determining the need for and the level of protection.
5. A program must be established for periodic air monitoring during site operations. Without an air monitoring program, any changes to air quality would go undetected and might jeopardize on-site personnel. Monitoring can be done with various types of air pumps and filtering devices, followed by laboratory analysis of the filtration media, personnel dosimeters, and periodic walk-throughs by personnel carrying real-time direct-reading survey instruments.
6. For operations in the exclusion zone, different levels of protection may be selected, and various types of chemical-resistant clothing may be worn. This selection should be based on the job function, reason for being in the area, and the potential for skin contact with, or inhalation of, the chemicals present.
7. Escape masks must be readily available when levels of respiratory protection do not include an SCBA and the possibility of an IDLH atmosphere exists. The use and placement of escape masks should be made on a case-by-case basis. Escape masks should be strategically located at the site in areas with a higher potential for vapors, gases, or particulates.

3.8 Decontamination of PPE

Roux prefers the use of single-use PPE to minimize the requirement for significant decontamination. The following procedures shall be considered should a field project require the need for decontamination of PPE. Roux has also developed a Site Control and Decontamination Management Program.

3.8.1 Site-Specific Decontamination Plans

The Project Manager (or another authorized individual) is responsible for formulating the site-specific PPE decontamination plan as an integral part of the Health and Safety Plan (HASP). The SHSO/SS' responsibilities include ensuring the plan's implementation and adapting it as site conditions evolve. Refer to Roux's Site Control and Decontamination Management program for additional requirements.

The decontamination plan, often created in conjunction with PPE selection, must be established prior to workers entering potentially contaminated areas. The plan should address the following key aspects:

- Decontamination Hazard Evaluation and Risk Assessment: Assessing risks associated with decontamination processes.
- PPE for Decontamination Line Assistants: Specifying appropriate PPE for personnel involved in decontamination.
- Roles and Responsibilities During Decontamination: Defining tasks and duties during the decontamination process.
- Layout and Quantity of Decontamination Stations: Determining the number and arrangement of decontamination stations, along with the designated PPE decontamination procedures at each station.
- Decontamination Equipment: Identifying the necessary equipment for effective decontamination.
- Decontamination Methods: Describing the methods and protocols for decontaminating personnel and equipment.
- Preventing Contamination of Clean Areas: Outlining procedures to prevent contamination of uncontaminated zones.
- Minimizing Contact with Contaminants During CPC Removal: Providing guidelines to reduce wearer exposure during the removal of Chemical Protective Clothing (CPC).
- Disposal Procedures for Inadequately Decontaminated Clothing and Equipment: Ensuring proper disposal practices for items that have not been adequately decontaminated.

The initial decontamination plan, which is developed in conjunction with the initial site hazard assessment, should be based on worst-case assumptions about the extent and type of contamination.

3.8.2 Emergency Decontamination of PPE

The designated SHSO/SS (or another authorized individual) assumes responsibility for addressing emergency decontamination within the site-specific Health and Safety Plan (HASP). Emergency decontamination may become necessary due to events such as fires, explosions, sudden violent storms, or medical emergencies. The emergency decontamination plan must clearly delineate emergency egress routes, as well as procedures for both decontamination and egress.

Some key points to consider regarding emergency decontamination.

- Immediate Notification: The SHSO/SS (or their designated counterpart) must be promptly informed of any circumstances requiring emergency decontamination. Additionally, they are accountable for tracking all personnel during the process.
- Urgent Medical Treatment: If urgent medical attention is necessary, decontamination of PPE may be delayed until the victim's condition stabilizes.
- Balancing Priorities: When feasible, decontamination should occur without hindering essential first aid. However, if a worker is exposed to an extremely toxic or corrosive substance, immediate decontamination is crucial to prevent severe injury or fatality.

- Heat-Related Illness: In cases of heat-related illness, protective clothing must be promptly removed (refer to Roux's Heat Illness Prevention Program).

Emergency Facilities:

- For workers potentially exposed to corrosive materials, quick drenching or flushing facilities must be provided in accordance with 29 CFR 1910.151(c) and 1926.50(g).
- Similarly, if workers face other hazards (such as splash or dust) that could harm the eyes or body, readily accessible wash stations are essential. These stations should be properly located and maintained, including regular water changes, as per the manufacturer's instructions.

3.8.3 Protection of Decontamination Line Assistants

Should work require a decontamination corridor the following shall be used as guidance. The SHSO/SS (or other designated person) must for ensuring that decontamination line assistants receive appropriate PPE and addressing their protection within the site-specific HASP. Key zones—namely, the Exclusion Zone (EZ), Contamination Reduction Zone (CRZ), and Clean Support Zone—must be clearly marked both in the field and within the site-specific HASP. The following should be considered when preparing for protection of decontamination line assistants.

1. Task Hazard Analysis: A thorough analysis must be conducted for line assistants to determine the optimal PPE level required. Factors influencing this decision include:
    - Expected or Visible Contamination on Responders
    - Type of Contaminant and associated respiratory and skin hazards
    - Total Vapor/Gas Concentrations in the CRZ
    - Presence of Particulates and specific inorganic or organic vapors in the CRZ
    - Results of Wipe Tests (refer to Section 5.4)
    - Slope and Configuration of the CRZ
2. PPE Levels: Depending on the situation:
    - Line assistants may need to wear the same PPE level as workers in the EZ.
    - Alternatively, line assistants may be adequately protected by using PPE one level lower (e.g., wearing Level C protection while decontaminating workers who are wearing Level B)."

3.8.4 Procedures to Minimize PPE Contamination

Proper work practices and procedures should be implemented at sites to minimize the potential for contact with chemicals of concern while onsite. The following guidance should be considered when developing site-specific procedures:

- Opt for single-use Personal Protective Equipment (PPE) when feasible to minimize decontamination needs.
- Ensure complete sealing of PPE closures and interfaces, including pockets, zippers, and other potential openings.
- Position gloves and boots underneath the sleeves and pant legs of outerwear to reduce exposure.
- Place hoods outside the collar if they are not already attached.
- Utilize disposable outerwear and equipment when suitable to facilitate easy disposal and reduce decontamination efforts.
- Secure all junctions with tape to block contaminants from entering gloves, boots, jackets, and suits.

- Adopt work practices that limit contact with hazardous substances, such as avoiding unnecessary exposure.
- Employ remote techniques for sampling, handling, and opening containers, like using drum grapples and pneumatic impact wrenches.
- Store monitoring and sampling devices in bags designed with openings for sample ports and sensors.
- Cover contaminant sources with plastic sheeting or overpacks to shield PPE from contamination.

3.8.5 PPE Disposal

The PM, in coordination with the field team, shall ensure the safe disposal of all wastes generated from PPE use. PPE must be placed in appropriate containers, labeled, and prepared for disposal separately from other forms of waste. Refer to Roux's General Waste Corporate Management Program for further guidance.

APPENDIX A
EPA's Emergency Responder Health and Safety Manual

GUIDELINES TO ENSEMBLES FOR SPECIFIC ACTIVITIES/TASKS WHERE CHEMICAL EXPOSURE IS POSSIBLE

GUIDELINES TO ENSEMBLES FOR SPECIFIC ACTIVITIES/TASKS
WHERE CHEMICAL EXPOSURE IS POSSIBLE

IMPORTANT: READ FOOTNOTES AND ASSUMPTIONS/JUSTIFICATIONS PRIOR TO USING TABLE

Notes:

1. This table is for use by trained environmental professionals only. To use this table:
   a. Scan the activity description to find activities (bolded) that most closely matches those you plan to engage in.
   b. Review Hazard/Conditions section to make sure the hazards of the planned activity match those listed. Note the Required Work Practices and be ready to follow them.
   c. For those activities most likely to be conducted as part the response, select Targeted Minimum PPE (Personal Protective Equipment).
   d. Necessary equipment needs to be available and used unless other information becomes available which necessitates an upgrade or allows a downgrade in the protection level. The work area must be continuously re-evaluated to ensure workers have the proper safety equipment.
   e. When working in hazardous environments, workers must always be aware of their surroundings. In addition to this Table, workers entering these environments need to use "common sense" prior to proceeding.
2. These ensembles focus on chemical protection and may not be adequate for all hazards. This Table can be used as a starting point but does not circumvent proper evaluation by an industrial hygienist in appropriate situations. See Table 2 for more specific chemical agents.
3. Suits, gloves, boots listed in the Minimum PPE column will not be appropriate for all activities, hazards and conditions. The listings should be used as a guide only. Confirm PPE compatibility with specific chemical contaminants.
4. A comprehensive Task Hazard Analysis must be performed prior to final selection of ensembles/PPE material types.
5. Hardhat (Class A or C), safety glasses/other eye protection are typically required but may not be specified here. In noisy environments (above 85dB) hearing protection is required. In areas where there is traffic, heavy machinery, or other hazards involving worker visibility problems a Class 2 High Visibility Vest must be worn. Activities requiring vests include natural disaster responses, demolitions, and excavations.
6. PPE makes and models referenced in these tables are only suggestions. Other comparable, adequate makes and models may be used.

Activity Description	Hazards/Conditions	Targeted Minimum PPE
Emergency Response and/or Initial Entry/Assessment – Low Hazard Expected (Sites/Facilities): • Air and Radiation Monitoring Sweep • Visual Assessment • Note Taking • Photo-documentation	• Suspected low hazard based on site history/visual evidence. • No CBRN suspected. • No visible/suspected vapors. • No potential for IDLH atmosphere. • Unknown physical hazards. • Some site background information. • No intrusive work expected. • Low potential for chemical splash/contact (based on expected tasks/ known conditions). • **Required Work Practice:** Immediate PPE Change-out (i.e., gloves, etc.) upon contact with chemicals. • **Required Work Practice:** Must follow standard air monitoring protocol.	**Level B** (Downgrade/upgrade based on knowledge of contaminants and monitoring with PID/FID, radiation detector, LEL/O_2 per HASP/ SOSGs) **Respirator: Scott or MSA Full Face** **Suit Type:** [I]Tychem CPF-3 (with boot, hood)/ChemTape **Inner Glove:** [II]Nitrile (6 mil min recommended) **Outer Glove:** [II]Neoprene, Nitrile, (28 mil min recommended) **Outer Steel Toe Boot:** [IV]Tingley HazProof Model 82330 **or** **Steel Toe Boot Cover**: [V]Latex HazMaster Booty and rely on suit boot material for permeation protection. **Steel Toe/Steel Shank Boots:** ASTM F-2413/ANSI Z41 **DECON**: Dry or soap & water

Activity Description	Hazards/Conditions	Targeted Minimum PPE
Emergency Response and/or Initial Entry/Assessment of Unknown – Potential Moderate Hazard (Sites/Facilities): • Air and Radiation Monitoring Sweep • Visual Assessment • Note Taking • Photo-documentation	• Possible high hazard chemicals based on site history/visual evidence (spills, corrosion, industrial practices, etc.). • No CBRN suspected. • No visible/suspected vapors. • **No** reasonable potential for **IDLH** atmosphere. • Unknown physical hazards. • Little/ no site background information. • No intrusive work expected. • Low potential for chemical splash/contact. • **Required Work Practice:** Immediate PPE Change-out (i.e., gloves, etc.) upon contact with chemicals. • **Required Work Practice:** Must follow standard air monitoring protocol.	**Level B** (Downgrade/upgrade based on knowledge of contaminants and monitoring with PID/FID, radiation detector, LEL/O_2 per HASP/ SOSGs) **Respirator: Scott or MSA Full Face** **Suit Type:** [I]Tychem Responder (with boot, hood)/ChemTape **Inner Glove:** [II]Nitrile (6 mil min recommended) **Outer Glove:** [II]Neoprene, Nitrile, (28 mil min recommended) **Outer Steel Toe Boot:** [IV]Tingley HazProof Model 82330 **or** **Steel Toe Boot Cover**: [V]Latex HazMaster Booty and rely on suit boot material for permeation protection. **Steel Toe/Steel Shank Boots:** ASTM F-2413/ANSI Z41 **DECON**: Dry or soap & water

Activity Description	Hazards/Conditions	Targeted Minimum PPE
Emergency Response and/or Initial Entry/Assessment of Unknown - Suspected High Hazard (Sites/Facilities): • Air and Radiation Monitoring Sweep • Visual Assessment • Note Taking • Photo-documentation	• Potential for high hazard chemicals/ IDLH based on site history/visual evidence (visible/expected reactions, spills, vapors, fumes, smoke, known releases, etc.). • No CBRN suspected. • Potential for chemical reactions. • Unknown physical hazards. • Little/ no site background information or information suggesting high hazard. • Intrusive work possible. • Potential for chemical splash/contact. • **Required Work Practice:** Immediate PPE Change-out (i.e., gloves, etc.) upon contact with chemicals. • **Required Work Practice:** Must follow standard air monitoring protocol.	**Level A** (Downgrade/upgrade (Trelleborg, etc.) based on knowledge of contaminants and monitoring with PID/FID, radiation detector, LEL/O_2 per HASP/ SOSGs) **Respirator: Scott or MSA Full Face** **Suit Type:** Encapsulating [I]Tychem Responder/Responder CSM (with boot, hood, gloves)/ChemTape **Inner Glove:** [II]Nitrile (6 mil min recommended) **Outer Glove:** [II]Neoprene, Nitrile, (28 mil min recommended) **Outer Steel Toe/Steel Shank Boot:** [IV]Tingley HazProof Model 82330 and rely on suit boot material for permeation protection. (ASTM F-2413/ANSI Z41) **DECON**: Dry or soap & water: water source for emergency DECON; other DECON agents on hand.

Activity Description	Hazards/Conditions	Targeted Minimum PPE
Drum/Tank Sampling • Container opening • Continuous air monitoring • Product sampling	• Unknown chemicals. • No CBRN. • Potential splash hazard. • Physical hazard controls in place. • Assumes no initial hazardous atmosphere. • Ensure availability of water source for emergency DECON/shower/eyewash. • **Required Work Practice:** Immediate PPE Change-out (i.e., gloves, etc.) upon contact with chemicals. • **Required Work Practice:** Must follow standard air monitoring protocol.	**Level B** (Upgrade/Downgrade based on knowledge of contaminants and monitoring with PID/FID, radiation detector, LEL/O_2 per HASP/ SOSGs) **Respirator: Scott or MSA Full Face** **Suit Type:** [I]Tychem Responder (with boot, hood)/ChemTape **Inner Glove:** [II]Nitrile, Neoprene, Viton, PVC **Outer Glove:** [II]Heavy Duty Butyl, Nitrile, **Other:** ANSI Approved Splash Shield **Outer Steel Toe Boot:** [IV]Tingley HazProof Model 82330 **or** **Steel Toe Boot Cover**: [V]Latex HazMaster Booty and rely on suit boot material for permeation protection. **Steel Toe/Steel Shank Boots:** ASTM F-2413/ANSI Z41 **DECON:** Dry DECON or soap and water; water source for emergency DECON and eyewash suggested.

Activity Description	Hazards/Conditions	Targeted Minimum PPE
Hazardous Categorization Testing (**HAZCAT**) • Opening sample containers in controlled environment • Working with small sample quantities in well ventilated area • Conducting HAZCAT testing with appropriate lab equipment	• Assumes known chemical classes and site situation/background. • No CBRN suspected. • Assumes immediate suit removal if contaminated and frequent glove changes. • **Required Work Practice:** Immediate PPE Change-out (i.e., gloves, etc.) upon contact with chemicals. • **Required Work Practice:** Must follow standard air monitoring protocol.	**Level B** (Upgrade/Downgrade based on knowledge of contaminants and monitoring with PID/FID, radiation detector, LEL/O_2 per HASP/ SOSGs) **Respirator: Scott or MSA Full Face** **Suit Type:** [I]Tychem CPF4 (with hood, boot) **Inner Glove:** [II]Nitrile **Outer Glove:** [II]Viton or 4-H (use surgie over the 4-H for dexterity) **Outer Steel Toe Boot:** [IV]Tingley HazProof Model 82330 **or** **Steel Toe Boot Cover**: [V]Latex HazMaster Booty and rely on suit boot material for permeation protection. **Steel Toe/Steel Shank Boots:** ASTM F-2413/ANSI Z41 **DECON:** Dry or soap and water; water source for emergency DECON and eyewash suggested

Activity Description	Hazards/Conditions	Targeted Minimum PPE
Oil Spill Response/Recovery Operations – Fresh Product: • Recovery operations (vac truck, skimmers, boom deployment where direct contact expected) • Product sampling • Continuous air monitoring at/near source of spill	• Crude oil/diesel/kerosene/gasoline spill. • Assumes fresh/ongoing spill, close proximity to source. • Assumes early phase while evaporation of light organics, benzene/other aromatics is still occurring (24-48 hours or if spill is on-going). • Assumes down-wind location. • Continuous air monitoring required for %LEL, Organics, $\%O_2$ (and H_2S as necessary for sour crude). • **Required Work Practice:** Immediate PPE Change-out (i.e., gloves, etc.) upon contact with chemicals. • **Required Work Practice:** Must follow standard air monitoring protocol.	**Modified Level C:** 1/2 face respirator w/safety glasses/goggles as needed for splash protection. Downgrade as appropriate based on air monitoring. **Respirator: Scott or MSA ½ Face** **Respirator Cartridge:** [III] Multi-Phase Cartridge (Scott 642 Multi-purpose; MSA with/GME P-100 or equivalent). **Suit Type:** [I]Tychem CPF4 w/boot [jet fuel use Tychem BR] **Inner Glove:** [II]Neoprene (for protection at DECON line only, not for prolonged contact) **Outer Glove:** [II]Viton-Butyl Rubber (assumes potential for direct contact with fresh material – based on benzene/aromatic constituents) SEE NEXT ROW FOR WEATHERED PRODUCT. **Outer Steel Toe Boot:** [IV]Tingley HazProof Model 82330 **or** **Steel Toe Boot Cover**: [V]Latex HazMaster Booty and rely on suit boot material for permeation protection. **Steel Toe/Steel Shank Boots:** ASTM F-2413/ANSI Z41 **DECON:** Dry DECON/ Soap and water as feasible

Activity Description	Hazards/Conditions	Targeted Minimum PPE
Oil Spill Response Assessment/Recovery – Weathered Product • Shoreline clean-up assessment (SCAT) • Environmental sampling/weathered product sampling • Recovery Operations for weathered material • Assessment via boat/on or near water – use appropriate flotation device with ensemble.	• Crude oil/diesel/kerosene/gasoline spill. • Assumes weathered oil (over 24-48 hours, depending on spilled material and ambient temperatures). • Assumes operations are remote from source of spill. • Assumes no other potential for airborne aromatics/benzene/flammable vapors.	**Modified Level D** (Upgrade/Downgrade based on potential for contact and air monitoring with FID/PID, LEL/O_2 Meter. **If contact with material suspected, use following:** **Suit Type:** [I]Tychem F w/boot [jet fuel-Tychem BR] (Tychem SL may be an option for weathered crude/diesel – see manufacturer's information) **Inner Glove:** [II]Nitrile **Outer Glove:** [II]Nitrile (Best Nitri-solv 727) **Outer Boot Cover:** [V]Latex HazMaster Booty **Steel Toe/Steel Shank Boots:** ASTM F-2413/ANSI Z41 **DECON:** Dry DECON/Soap and water as feasible

Activity Description	Hazards/Conditions	Targeted Minimum PPE
Demolition/Excavation Operations: • Heavy equipment operation • Excavation/Trenching • Continuous air monitoring when soil is disturbed or demolition activities conducted. • Fuel Oil underground tank removal. • Drum Excavation activities EXCLUDED.	• Demolition activities generating potentially hazardous particulates (asbestos, lead, silica, etc.). • Excavation activities that could expose soil contaminated with low levels of known hazardous chemicals to the surrounding area /in the trench/ excavation. • No potential for IDLH atmosphere. • Site background information available. • Known physical hazards. • Workers will have minimal/ no contact with contaminants (i.e., operators in a cab, inspectors/ observers at a safe distance). • Continuous air monitoring required in trench for %LEL, Toxics, and $\%O_2$ when workers are in trench and for particulate when activities generating particulate are conducted. • **Required Work Practice:** Must follow standard air monitoring protocol.	**Modified Level C:** 1/2 face respirator w/safety glasses. Downgrade or upgrade as appropriate based on air monitoring. **Respirator: Scott or MSA ½ Face** **Respirator Cartridge:** [III] Multi-Phase Cartridge (Scott 642 Multi-purpose P-100; MSA with/GME P-100 or equivalent). **Suit Type:** [I]Proshield Next Gen **Inner Glove:** NA **Outer Glove:** Leather **Outer Steel Toe Boot: NA** **Steel Toe Boot Cover**: [V]Latex HazMaster Booty (if chemical in soil is possible) **Steel Toe/Steel Shank Boots:** ASTM F-2413/ANSI Z41 **DECON:** Dry DECON/ Soap and water as feasible

Activity Description	Hazards/Conditions	Targeted Minimum PPE
Natural Disaster Response (Hurricane, Tornado, Flood, Earthquake) - Orphan Container Recovery: • Routine hand collection/pick-up of small containers from debris piles/lines • Land based operations - conducted on foot **Note:** Physical Hazards may necessitate PPE modifications.	• Unknown materials – confident identification based on visual observations. • **Required Work practice:** re-evaluate prior to moving suspicious containers. Air monitoring and PPE upgrade may be required. • **Required Work Practice:** Immediate PPE Change-out (i.e., gloves, etc.) upon contact with chemicals. • **Required Work Practice:** Must follow standard air monitoring protocol.	**Modified Level D:** Upgrade/downgrade based on suspicious containers (not easily identified visually) and air monitoring with PID/FID, radiation detector, LEL/O_2 per HASP/ SOSGs **Suit Type:** [I]Tychem CPF-3 w/boot **Inner Glove:** [II]Nitrile **Outer Glove:** [II]Nitrile (Best Nitri-solv 727) or Leather **Outer Boot Cover:** [V]Latex HazMaster Booty **Steel Toe/Steel Shank Boots:** ASTM F-2413/ANSI Z41 **DECON:** Dry DECON/Soap and water as feasible
Natural Disaster Response (Hurricane, Tornado, Flood, Earthquake) - Orphan Container Recovery: • Routine Drum recovery from debris lines/piles/ other – conducted on land **Note:** Physical Hazards may necessitate PPE modifications.	• Unknown materials – confident identification based on visual observations. • **Required Work practice:** re-evaluate prior to moving suspicious containers. Air monitoring and PPE upgrade may be required. • **Required Work Practice:** Immediate PPE Change-out (i.e., gloves, etc.) upon contact with chemicals. • **Required Work Practice:** Must follow standard air monitoring protocol.	**Modified Level D:** Upgrade/downgrade based on suspicious containers (not easily identified visually) and air monitoring with PID/FID, radiation detector, LEL/O_2 per HASP/ SOSGs **Suit Type:** [I]Tychem CPF-3 w/boot **Inner Glove:** [II]Nitrile **Outer Glove:** [II]Nitrile (Best Nitri-solv 727) or Leather **Outer Boot Cover** [V]Latex HazMaster Booty **Steel Toe/Steel Shank Boots:** ASTM F-2413/ANSI Z41 **DECON:** Dry DECON/Soap and water as feasible

Activity Description	Hazards/Conditions	Targeted Minimum PPE
Natural Disaster Response (Hurricane, Tornado, Flood, Earthquake) – Flood water sampling: • Water Sampling of flood waters where potential for contact with hands/feet is high **Note:** Physical Hazards may necessitate PPE modifications.	• Unknown contaminants • Potential for pathogens suspected • Low potential for acute exposure to hazardous chemicals • Assumes open air/well ventilated areas **Required Work Practice:** Monitor all poorly ventilated areas in appropriate PPE/Respiratory Protection for organic vapors (PID & FID), %LEL/flammable atmospheres, H_2S prior to entry	**Modified Level D:** Upgrade based on more information as it becomes available. **Suit Type:** [I]Proshield Next Gen **Inner Glove:** [II]Nitrile **Outer Glove:** [II]Nitrile (Best Nitri-solv 727) **Outer Boot**: Waders (butyl, neoprene) as needed. **Steel Toe/Steel Shank Boots:** ASTM F-2413/ANSI Z41 **DECON:** Dry DECON/Soap and water as feasible
Environmental Sampling (Low Concentration Water/Soil/Perimeter Air): • Multi-media Sampling • Documentation (written/photo) • Inspection of clean-up operations	• Known Chemical Contaminants. • Airborne concentrations well below PELs. • Minimal chance of skin exposure to chemicals. • Insects possible.	**Level D:** Upgrade based on more information as it becomes available. **Suit Type:** [I]Proshield 1 (if ticks, etc. maybe a problem) **Inner Glove:** [II]Nitrile **Outer Glove:** NA **Outer Boot:** NA **Steel Toe Boots:** ASTM F-2413/ANSI Z41 **DECON:** NA

i. Tychem and Proshield suits can be purchased from Safeware: 800-331-6707, http://www.safewareinc.com , (see also LSS, http://www.labsafety.com, Dupont: 1-800-931-3456, http://www2.dupont.com/Personal_Protection/en_US/index.html)

ii. Nitrile Inner/Outer Gloves; Viton; Butyl Rubber; 4-H (polymeric) can be purchased from Safeware: 800-331-6707, http://ww.safewareinc.com ; Airgas: 1-866-718-0685, http://www.airgas.com (see also North Safety, http://www.northsafety.com); Best Gloves, http://www.bestglove.com ; Lab Safety Supply (LSS), http://www.labsafety.com; Airbill, http://www.airbill.com)

iii. Multi-Phase Cartridge (Scott 642 Multi-purpose; MSA with/GME P-100 or equivalent) can be purchased from LSS: 1-800-356-0673, http://www.labsafety.com (see also Safeware, http://www.safewareinc.com; Scott Safety, http://www.scotthealthsafety.com/; MSA, http://www.msanet.com/)

iv. Tingley HazProof Overboots or similar can be purchased from LSS: 1-800-356-0673, http://www.labsafety.com; National Safety, Inc.: 1-800-213-7092, http://www.nationalsafetyinc.com

v. Latex Hazmaster Booties, Nuke Boot or similar can be purchased from Safeware: 800-331-6707, http://www.safewareinc.com; Airbill: 1-215-632-2000, http://www.airbill.com; (see also Airgas, http://www.airgas.com; LSS, http://www.labsafety.com

APPENDIX E

Subsurface Utility Clearance Management Program

SUBSURFACE UTILITY CLEARANCE MANAGEMENT PROGRAM

CORPORATE HEALTH AND SAFETY DIRECTOR	**:**	**Brian Hobbs, CIH, CSP**
EFFECTIVE DATE	**:**	**01/2019**
REVIEW DATE	**:**	**03/2025**
REVISION NUMBER	**:**	**5**

TABLE OF CONTENTS

1. PURPOSE 1
2. SCOPE AND APPLICABILITY 1
3. PROCEDURES 1
3.1 Before Intrusive Activities/Job Planning Process 1
3.1.1 Project Kick-Off Meeting 2
3.2 Utility Mark Out 2
3.3 Site Visit/Utility Walkthrough 3
3.3.1 Project Management - Field Personnel 4
3.3.2 Utility Markings 4
3.4 Preferred Methods of Clearing the Subsurface (Pre-Clearing) 6
3.4.1 Guidance for Tools and Equipment 6
3.5 During Intrusive Activities 7
3.5.1 Concrete/Paving Surface Removal 7
3.5.2 Pre-Clearance Procedures 7
3.6 Stop Work Authority 8
3.7 Reporting Utility Incidents 8

APPENDICES

Appendix A – Roux Subsurface Utility Clearance Checklist/ Utility Verification/Site Walkthrough Record

Appendix B – Private Utility Technology Applications and Considerations

1. PURPOSE

Roux Associates, Inc. and its affiliated companies, Roux Environmental Engineering and Geology, D.P.C., and Remedial Engineering (collectively, "Roux"), have instituted the following program for completing proper utility mark-outs and for conducting subsurface clearance activities. This establishes a method to ensure, to the greatest extent possible, that utilities have been identified and contact and/or damage to underground utilities and other subsurface structures will be avoided. For the purpose of this program, a structure is defined as any underground feature that may present a potential source(s) of energy, such as, but not limited to, utility vaults, bunkers, piping, electrical boxes, wires, conduits, culverts, utility lines, underground tanks, and ducts.

2. SCOPE AND APPLICABILITY

The Subsurface Utility Clearance Management Program applies to all Roux employees, as well as their contractors and subcontractors. Employees are expected to follow this program for all intrusive work involving Roux or other personnel (e.g., contractors, subcontractors) working for Roux, unless the client's requirements are more stringent. Intrusive work activities can include, but are not limited to, digging or scraping the ground surface, including, but not limited to, excavation; test pitting or trenching; soil vapor sampling or the installation of soil borings, soil vapor monitoring points and wells, or monitoring wells; and drilling within concrete slabs on grade.

Deviation from the program, regardless of the specific work activity or location, must be pre-approved based on the client's site knowledge, experience, site conditions, and additional documentation on the site. Any exceptions shall be documented through the Roux Subsurface Utility Clearance Variance Form, located within the Roux Health & Safety Online Application or via OKTA. Approval is required from the Project Principal (PP) and the Operations Manager (OM), in consultation with the Office Health and Safety Manager (OHSM) or Corporate Health and Safety Director (CHSD), prior to mobilization. Depending on the work location, more stringent federal, state, local, or client requirements may apply. It is the responsibility of the Project Team to identify such requirements prior to mobilization.

3. PROCEDURES

3.1 Before Intrusive Activities/Job Planning Process

Prior to intrusive work at a site, the Project Manager (PM) shall ensure that the notification of the State One Call or equivalent service (Nationwide-811) is completed a minimum of 48-72 hours (One-Call State Law Directory) before intrusive work activities (this timeline excludes Saturdays, Sundays, Legal Holidays and 811 observed holidays). This notification is required by law for all states. State-specific or local laws related to utility location may vary. The project team is responsible for understanding requirements that may affect their work site.

Obtain, review, and field verify relevant historical site data that may include: as-builts/site plans; easement/right-of-way information; historical aerial photos/development plans; local/state permitting records; previous site investigation/boring logs; and/or interviews with site representative/client. Interviews with site or client personnel should ask the following:

- Employee(s) Name and Relationship with the site;
- Types of utilities, including structure and location of utilities on-site;
- Depth of known utilities; and
- Any other relevant information as it pertains to the site.

Prior to intrusive work activities, information pertaining to the site should be included in Roux's Subsurface Utility Clearance Checklist and Utility Verification/Site Walkthrough forms. This form is located within the Roux Health & Safety Online Application or through OKTA.

If there is the potential for unexploded ordnances or munitions, consultation with your OM and CHSD is required prior to site operations.

3.1.1 Project Kick-Off Meeting

During the project kick-off meeting for intrusive activities, the PM will review the Roux Subsurface Utility Clearance Checklist, Utility Verification / Site Walkthrough Record (Appendix A) and the below bullet points with the project field team:

- Confirm that the State One Call or equivalent is received and that the ticket number is confirmed, reviewed, and valid for the time of work. If intrusive work activities are not conducted during this valid time period, the One Call ticket must be renewed, and the site must be remarked;
- Review the work scope to be performed with the site owner/tenant to determine if it may impact any utilities;
- Determine the need for utility owner companies to be contacted or to have their representatives on site;
- Where mark-outs terminate at the property boundary, consider the use of private utility locating / (e.g., Radio Frequency Detection, Electromagnetic Induction), Ground Penetrating Radar (GPR) , and other applicable geophysical inspection services. The use of private utility locating firms, however, does not eliminate the legal requirement for the subcontractor (e.g., driller, excavation firm) to submit a request for Public Utility Mark-outs. Also, the information provided by the service may be inaccurate and unable to locate subsurface utilities and structures in urban areas, landfills, urban fill areas, below-reinforced slabs, etc. They should not be relied upon as the only means of performing utility clearance;
    - A mark-out is defined as the process of contracting with a competent and qualified company to confirm the presence or absence of underground utilities and structures. This process will clearly mark out and delineate identified utilities so that intrusive work activities can be performed without causing disturbance or damage to the subsurface utilities and structures. After utility mark-outs are completed, soft Digging must completed prior to intrusive work. Section 3.4 Preferred Methods of Clearing the Subsurface (Pre-Clearing) outlines requirements for pre-clearing techniques in order of preference.
- Documented description of the dig site, which is included in the project's Health and Safety Plan (HASP), and one call report will be maintained in the field and distributed amongst Roux personnel, its contractors, and subcontractors; and
- Documentation of the actual placement of mark outs in the field shall be collected using dated pictures, videos, and/or sketches with distance from markings to fixed objects. All documentation shall be maintained within the project file.

3.2 Utility Mark Out

- Ensure the Mark-out / Stake-out Request Information Sheet (or one-call report) is complete and accurate for the site, including address and cross streets, and review for missing utilities. Ensure ticket life is still valid for work.
    - Note: Utility mark-out organizations do not have contracts with all utilities, and it is often necessary to contact certain utilities separately, such as the local water and sewer authorities, local transportation departments, and railroad operators. In the event the Project Teams

anticipate subsurface work will impact public utilities, railroad operations, or public roadways, coordination with the utility owners/operators is required.

- Have written confirmation prior to mobilizing to the site that the Project Team or Roux personnel performing the intrusive activity has correctly completed the mark-out notification process, including requesting mark-outs, waiting for mark-outs to be applied to ground surfaces at the site, and receiving written confirmation of findings (via fax or email) from utility operators for all known or suspected utilities in the proposed area of intrusive activity, and provided utility owner written confirmation to Roux personnel for review and project files documentation.
- Do not begin any intrusive activity until all utility mark-outs have been completed (i.e., Did all utilities mark-out the site?) and any unresolved mark-out issues are finalized. Perform a site walk to review the existing utilities and determine if the utility locators have located said utilities.

  (Note: The Tolerance Zone is defined as three feet from the outside edge of any subsurface structure.)
- For non-subscribing utility owners or if public one-call service is not available, perform due diligence and request further information regarding utility type, construction details, location, and burial depth directly from public service providers/utility owners. Request utility mark-out by each public service provider/utility owner as applicable. Confirm contact and response by each public utility owner on the Subsurface Utility Clearance Checklist.
- If utilizing a Private Mark out, ensure the contractor has a plan regarding what types of technology will be used based on Table 1 in Appendix B: Private Utility Technology Applications and Considerations. If possible, it is recommended that multiple technologies be used to sweep each location/work area. Use a tracer wire to locate the utility (when tracer wires are present). Record the results of the private utility mark-out on the Utility Verification/Site Walkthrough Record form.

3.3 Site Visit/Utility Walkthrough

Before mobilization with the subcontractor or during the pre-work safety tailgate with the subcontractor, perform a site walkthrough after utility mark-outs have been completed to determine whether additional potential hazards are present and look for visible signs of utilities that may be present. Outlined below are considerations regarding a site walk before intrusive activities. Before initiating any intrusive work, verify that the utilities marked on-site align with the information provided in the One Call response notification/ticket and with site plans and documents. If any discrepancies arise, address them promptly to ensure accuracy and do not start intrusive work until they are rectified.

- Identify overhead utilities that may impede equipment mobilization or work zones to ensure adequate Occupational Safety and Health Administration (OSHA) clearance distance(s), as specified within the site-specific Health and Safety Plan (HASP) and 29 CFR 1926.1408 Table A.

The presence of any of the following may indicate potential subsurface structures:

- Locations of buildings, equipment, and features like area lights, signs, sprinkler systems, phones, drains, natural gas meters, manholes, etc.;
- Warning tape, which is often a sign of underground services;
- Material like pea gravel, sand, or other non-native materials can indicate the presence of tanks or lines or any deviations from the established native soil or backfill conditions;
- Red concrete that is often used for electrical duct banks;
- Evidence of damaged utilities, such as piping materials, insulation, or odors present in the work area; and

- Other utilities, including fire hydrants, electrical transformers, pipeline markers, valve covers, steam lines, valve box covers, clean-outs, etc.

By observing the path between the main service line and the connection point (e.g., a utility meter at the exterior of the site building), it may be possible to determine the likely routing of on-site utilities. However, this method should not be relied upon solely, and proper risk mitigation strategies should be in place before proceeding with any ground disturbance activities. Look outside your work zone for other potential utilities that may cross through it.

For sites with potential underground storage tanks present (UST), the following guidance applies:

- Identify if the product piping is either rigid or flexible.
- Conduct a visual examination of the tank field, observation wells, dispensers, vent stacks, and UST fill points to determine their location.
- Locate and become familiar with the emergency shutoff button/switch, if present.
- Determine the orientation, arrangement, and location of the tanks, as well as their size and capacity, through the examination of visible features at grade, such as fill ports and extractor covers, and by consulting any available as-built drawings.

Before commencing any subsurface intrusive work, field staff should thoroughly address any discrepancies in utility company mark-outs or the absence of mark-outs.

3.3.1 Project Management - Field Personnel

Whenever possible, it is advisable to assign the same project personnel to both utility location and clearance tasks as well as intrusive activities. This continuity ensures that site knowledge and utility information gathered during the clearance phase remain up-to-date. Having this historical perspective helps minimize the risk potential of utility strikes.

In cases where maintaining the same personnel throughout the project is not feasible, a thorough knowledge transfer regarding site utilities, locations, clearance results, and proposed intrusive activities becomes essential. The PM must ensure that there is a successful handoff of information when there is a change in field personnel.

3.3.2 Utility Markings

The utility marking color code includes various uniform colors. The following APWA uniform color code (ANSI Z535.1) is provided below. While certain government agencies or large industrial facilities may use additional colors, Roux's policy is to consider any unlisted paint marking or pin flag color as a subsurface utility marking unless proven otherwise.


If utilities or subsurface anomalies are identified but their type or classification remains uncertain, it is advised to employ pink paint or pin flag (Temporary Survey Marking) for marking. Once the utility type is definitively established, the pink marks should be updated to represent the correct type of utility accurately.

White	Proposed Excavation
Pink	Temporary Survey Markings
Red	Electric Power Lines, Cables, Conduit, and Lighting Cables
Yellow	Gas, Oil, Steam, Petroleum, or Gaseous Materials
Orange	Communication, Alarm or Signal Lines, Cables, or Conduit
Blue	Potable Water
Purple	Reclaimed Water, Irrigation, and Slurry Lines
Green	Sewers and Drain Lines

Understanding the markings left by locators during the 811 process is crucial for avoiding utility-related issues. Typically, these markings are done when Roux staff members are not physically present on-site. To enhance understanding/accuracy, it is advisable for staff to be present during the 811 process or engage in conversations with locators, both public and private, while on-site. Additionally, utility marks must adhere to the proper standards outlined in the Uniform Color Code.

Common Abbreviations *(Source: Common Ground Alliance)*

Facility Identifier		Underground Construction Descriptions		Infrastructure Materials	
CH	Chemical	C	Conduit	ABS	Acrylonitrile - Butadiene - Styrene
E	Electric	CDR	Corridor	ACP	Asbestos Cement Pipe
FO	Fiber Optic	D	Distribution Facility	CL	Cast Iron
G	Gas	DB	Direct Buried	CMC	Cement Mortar Coated
LPG	Liquefied Petroleum	DE	Dead End	CML	Cement Mortar Lined
PP	Petroleum Products	JT	Joint Trench	CPP	Corrugated Plastic Pipe
RR	Railroad Signal	HP	High Pressure	CMP	Corrugated Metal Pipe
S	Sewer	HH	Hand Hole	CU	Copper
SD	Storm Drain	MH	Manhole	CWD	Creosote Wood Duct
SS	Storm Sewer	PB	Pull Box	HDPE	High Density Polyethylene
SL	Street Lighting	R	Radius	MTD	Multiple Tile Duct
STM	Steam	STR	Structure (vaults, junction inlets, lift station)	PLA	Plastic (conduit or pipe)
SP	Slurry System	T	Transmission Facility	RCB	Reinforced Concrete Box
TEL	Telephone			RCP	Reinforced Concrete Pipe
TS	Traffic Signal			RF	Reinforced Fiberglass
TV	Television			SCCP	Steel Cylinder Concrete Pipe
W	Water			STL	Steel
W	Reclaimed Water "Purple"			VCP	Vitrified Clay Pipe

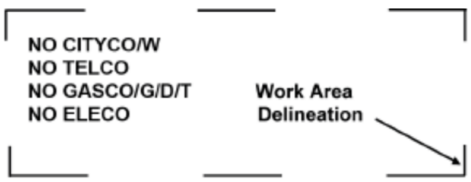

3.4 Preferred Methods of Clearing the Subsurface (Pre-Clearing)

At least one of the methods listed below shall be carried out during pre-clearing activities. The Project Team is responsible for evaluating risks associated with the Scope of Work to determine which method is selected.

If none of the following pre-clearing activities are performed, a Subsurface Utility Clearance Variance must be submitted to the OM. This Subsurface Utility Clearance Variance must provide clear lines of evidence that there are no utilities present within the intrusive work zone. Examples include demolition permits of the site, utility closure documents indicating no live utilities on-site, as-builts, site history, etc.

The following approaches shall be considered and implemented based on the Scope of Work.

- ***Soft Digging***
  - This is the preferred method of utility clearance when clearing higher-risk utilities. Soil should be cleared through the use of a vacuum truck/equivalent, an accompanying air knife (preferred), or a water lance to break up and loosen the soil for removal with the vacuum.
- ***Hand Digging***
  - Soil should be broken up and removed using a shovel or other appropriate hand tools without excessive force. Limit the use of dig bars or other tools that, if used incorrectly, can significantly damage utilities.
- ***Hand Augering***
  - The hand auger must be turned slowly using even hand pressure without excessive force. Rounded-edge augers are preferred. Hand augers should not be used in pea stone/pea gravel where utilities may be present and could potentially be damaged by the hand auger. The abrupt absence of soil recovery in a hand auger could indicate utilities as pea gravel or sand may have spilled out of the auger (exception: native soil conditions that typically result in poor hand auger recoveries). If any resistance is encountered while operating the hand auger for pre-clearance, the equipment will be removed, and the exploratory test hole will be visually inspected by onsite personnel for any obstructions or indications of subsurface structures.

3.4.1 Guidance for Tools and Equipment

Personnel performing pre-clearance activities shall keep tools and equipment in safe working order and be properly inspected before use. If tools or equipment are broken, they will be tagged and removed from service. The following specify additional guidelines regarding tools and equipment:

- Hand-digging tools must have a non-conductive handle, such as fiberglass, wood, or composite, or fully insulated handles and potential contact surfaces.
- Blades on shovels and post-hole diggers should have rounded or blunt edges.
- Pick axes or pointed spades should not be used for physical clearance.
- Crowbars, pinch-bars, or pry bars should not be used to break hardened soil or backfill except when authorized by the Site Supervisor (SS). This should only be used to loosen materials like bricks or larger stones.
- Electric-powered equipment must have ground-fault protection.
- Should there be refusal or difficulty with advancing hand tools, the contractor shall stop work and notify the Roux SS or Site Health and Safety Officer (SHSO) immediately.

3.5 During Intrusive Activities

3.5.1 Concrete/Paving Surface Removal

Remove any surface coverings (i.e., pavement, brush, debris, etc.) to ensure workers have clear visibility of the work area and subsurface conditions. Avoid mechanical jackhammering over known lines unless they are de-energized, locked-out/tagged-out, and potential repairs are planned or if the utility has been completely disconnected prior. When cutting or coring, go only as far as needed to penetrate the surface cover. When removing a large surface area, begin at the perimeter of the removal zone. This initial step helps identify any utilities passing through the work zone. For extensive areas, using a concrete saw might not be practical. Instead, heavy equipment is often employed. During this process, a designated spotter should guide the heavy equipment. Their role is to watch for warning signs of utilities. It is crucial that the heavy equipment does not have “teeth” that could potentially pass through the surface and damage utilities.

3.5.2 Pre-Clearance Procedures

Install pre-clearance exploratory test holes using one of the techniques, as outlined in Section 3.4, for the first 5-ft below land surface (BLS) at each location before conducting intrusive mechanized activities. Should utilities be located at a greater depth than 5-ft BLS consult with the OM, OHSM and CHSD regarding adjustments to the pre-clearance requirements to go greater than 5-ft BLS. Some Clients may require greater than 5-ft BLS for pre-clearance test holes; Project teams should be aware of such Client requirements prior to work.

Pre-clearance exploratory test holes should be defined in the SOW/proposal provided to the client to prevent project delays and to allow adequate time for the PM and PP to evaluate alternative approaches for the project. Alternative approaches will need to be pre-approved by the OM through a Subsurface Utility Clearance Variance.

Both single-point and three-point clearance are acceptable as long as the following criteria are met below. For single-point clearance, the exploratory test hole is advanced at the exact location of the proposed borehole. If three-point clearance is performed, it must be done in a triangular pattern around the proposed borehole and in a configuration that would not allow utilities to enter the borehole.

- The size of the pre-clearance exploratory test hole should be, at a minimum, twice the diameter of any downhole tool or boring device.
- For direct push applications (CPT, Geoprobe®, etc.), the borehole clearance diameter shall be at least 125% of the diameter of the largest tool being pushed through the subsurface (e.g., tip, rod, sampler, etc.), to the minimum required depth.
- For excavations, all utilities need to be marked and then exposed by soft-digging or by hand, following the protocols in this program. Pre-clearing for excavations may be performed by the “moat” technique (i.e., soft Digging around the perimeter). In these cases, dig in small lifts (<12” for first 5 feet using a dedicated spotter.
- For Tolerance Zone work, unless otherwise agreed upon with the Utility Operator, work within the tolerance zone requires verification by means of pre-clearance test holes specified in Section 3.4 to expose the utility. Once structures have been verified, a minimum clearance of three feet must be maintained between the utility and any powered equipment. If considered a high-risk utility, additional requirements may be necessary and required by the Operator of the utility. Consultation with the OM and CHSD may be appropriate.

The PM, field team lead, or personnel performing oversight is to:


- Ensure the mark-out remains valid. (In certain states, there are limits regarding the duration of time after the mark-out was applied to the ground surface work can be started or interrupted.) Additionally, the mark-outs must be maintained, documented, and in many cases, refreshed periodically to be considered valid. This will be accomplished through calls to the one call center.
- Ensure intrusive activities are only performed within the safe boundaries of the mark-out as detailed in the One-Call Report.
- Halt all work if intrusive activities have resulted in the discovery of an unmarked utility. Roux personnel shall notify the facility owner/operator and the one call center. All incidents such as this will be reported as per Roux Incident Investigation and Reporting Management Program.
- Halt all work if intrusive activities must take place outside of the safe boundaries of a mark-out and only proceed after new mark-outs and subsurface utility clearance are performed.
- Halt the intrusive activities and immediately consult with the PP if an unmarked utility is encountered.
- Complete any loss reports associated with subsurface utility strikes, as necessary.
- If a utility cannot be found as marked, Roux personnel shall notify the facility owner/operator directly or through the one-call center. If the facility operator is not responsive, then the one-call center must be notified. Following notification, the excavation/mechanical intrusive work may continue unless otherwise specified in state law.
- Contractors/subcontractors must contact the one-call center to refresh the ticket when the excavation continues past the life of the ticket. State law dictates ticket life. Project teams must be aware of their state-specific requirements.

3.6 Stop Work Authority

Each Roux employee has Stop Work Authority that he or she will execute upon determination of any imminent safety hazard, emergency situation, or other potentially dangerous situation, such as hazardous weather conditions. This Stop Work Authority includes subsurface clearance issues such as the adequacy of a mark-out or identification during intrusive operations of an unexpected underground utility. Authorization to proceed with work will be issued by the PM/PP in consultation with the OHSM after such action is reviewed and resolved. The PM will initiate and execute all management notifications and contact emergency facilities and personnel when this action is appropriate.

3.7 Reporting Utility Incidents

Roux field personnel engaged in any utility strike (e.g., subsurface/aboveground) must promptly stop work, shutdown any equipment and get to a safe location at the Site. Then notify the PM to discuss the incident. In case of injuries, field personnel must call 911 or the local emergency services number and then inform the PM. Additional notifications shall follow Roux's Incident Notification Process. Depending on the utility strike additional notifications shall be made to utility operators and/or clients/site contacts.

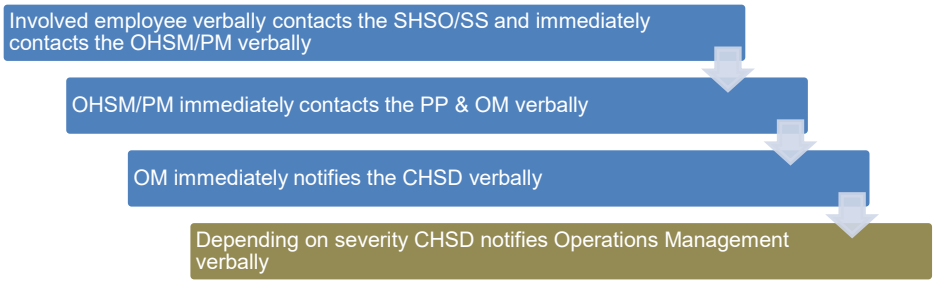

Appendix A
Roux Subsurface Utility Clearance Checklist

Appendix A

Roux Subsurface Utility Clearance Checklist/Utility Verification/Site Walkthrough Record

Roux Subsurface Utility Clearance Checklist ***Date of Revision: 3/2024***

Work site set-up and work execution

ACTIVITY	Yes	No	N/A	COMMENTS INCLUDING JUSTIFICATION IF RESPONSE IS NO OR NOT APPLICABLE
Daily site safety meeting conducted, SPSAs performed, JSAs reviewed, appropriate work permits obtained (if applicable).				
HASP is available and reviewed by site workers / visitors.				
Subsurface Utility Clearance Procedure has been reviewed with all site workers.				
Mechanical intrusive work activities may not be performed at any location without authorization from the Roux Site Supervisor (SS). Clearance activities may not be performed at any location unless the SS is physically present.				
Work area secured; traffic control established as needed. Emergency shut-off switch located. Fire extinguishers / other safety equipment available as needed.				
Utility mark-outs (public / private) clear and visible. Provide Excavator's Stake-Out Reference Number / Request Date / Time.				
Tolerance zone work identified. Intrusive work activities cannot be performed in areas that are in direct conflict with any markings made by public or private locators.				
Unless the PP & OM authorizes it, all boreholes and test pit locations must be physically cleared before using mechanized equipment. Required minimum physical clearance depths and diameters are as follows: • Physically clear to a depth of 5 feet bls. • The size of the pre-clearance exploratory test hole must be, at a minimum, twice the diameter of any downhole tool or boring device. • For direct push applications (CPT, Geoprobe®, etc.) the borehole clearance diameter shall be at least 125% to the diameter of the largest tool being pushed through the subsurface (e.g., tip, rod, sampler, etc.).				
Work execution plan reviewed and adhered to (ground disturbance methods, clearance depths, any special utility protection requirements, or any other execution requirements; especially for Tolerance Zone work).				

Mechanical intrusive work is prohibited within 3-feet distance in all directions from subsurface structures that will be intentionally exposed during pre-clearance. Any removal of material within 3-feet of the subsurface structure may only proceed by hand using non-conductive tools/compressed air if authorized by state law and the owner/operator of the utility.				
All equipment onsite must maintain the appropriate horizontal distance from any point on the equipment to the nearest overhead electrical power line. Refer to site-specific HASP and local/utility company requirements.				
Verbal endorsement received from Roux PM and OM for any required field deviations to work execution plan.				

Key Reminders for Execution

The Subsurface Utility Clearance Protocol should be referenced to determine all requirements while executing subsurface work. The bullet points below are intended as general reminders only and should not be relied upon solely.

- The size of the pre-clearance exploratory test hole must be at a minimum twice the diameter of any downhole tool or boring device to minimum required depth of 5 feet bls.
- For direct push applications (CPT, Geoprobe®, etc.) the borehole clearance diameter shall be at least 125% of the diameter of the largest tool being pushed through the subsurface (e.g., tip, rod, sampler, etc.), to the minimum required depth of 5 feet bls.
- The tolerance zone is defined as three feet plus half of the diameter or half of the greatest dimension (for elliptical sewers, duct banks, and other non-cylindrical utilities) of a utility and three feet from the outside of any subsurface structure.
- For excavations, all utilities need to be marked and then exposed by hand, following the protocols in this program. Pre-clearing for excavations may be performed by the “moat” technique (i.e., soft digging around the perimeter). In these cases, dig in small lifts (<12” for first five feet) using a dedicated spotter.) For Tolerance Zone work, unless otherwise agreed upon with the Utility Operator, work within the tolerance zone requires verification by means of hand-dug test holes to expose the utility. Once structures have been verified, a minimum clearance of three feet must be maintained between the utility and any powered equipment.

Utility Verification/Site Walkthrough Record

Employee Name:_____


Date: _____

Instructions: For each utility suspected at the job site, indicate the location on the job site, approximate burial depth, and means of detecting the utility. Leave blank if that utility is not believed to be present.

Utility	Description of Utility Location Identified Onsite	Approx. Depth (bls)	Method / Instrumentation used to determine Utility Location	Utility Owner Response (Date/Time)	Mark Out Indicates (Clear / Conflict)
Electrical Lines					
Gas Lines					
Pipelines					
Steam Lines					
Water Lines					
Sanitary and Stormwater Sewer lines					
Pressured Air-Lines					
Tank Vent Lines					
Fiber Optic Lines					
Underground Storage Tanks					
Phone Lines/ Other					

* bls - below land surface

Site Sketch Showing Utilities:

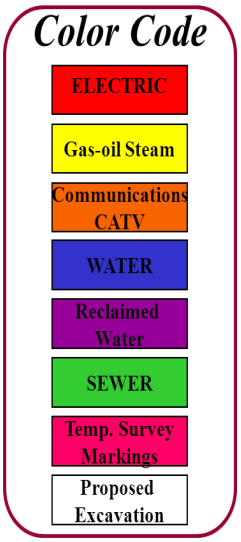

Other Comments / Findings:

Completed by: _____

Signature: _____ Date: _____

Appendix B
Private Utility Technology Applications and Considerations

Appendix B – Private Utility Technology Applications and Considerations

Technology ⇒ Utility/Object ⇓	Radio Frequency Electro-Magnetic Detector (connection to utility, or induction without connection)	Radio Frequency Electro-Magnetic Detector (passive sweep)	Ground Penetrating Radar (GPR)⊙	Acoustic Plastic Pipe Locator	Beacon, Sonde or Conductive Rodder Insertion	EM-61 (time domain electromagnetics) Ξ	
Power/Instrument Line (Energized/Signaled) □	❋ G	G	G	R	R	G	
Power Line (Non-energized) □	❋ G	R	G	R	R	G	
Sewer/Water Line (Metallic) □	❋ G	Y	G	Y	G	G	
Sewer/Water Line (Non-metallic)	R	R	G	G	❋ G	R	
Instrument / Telecomm Lines (Non-energized)	❋ G	R	G	R	R	Y Only if metallic	
Hydrocarbon Transmission Line (Pipeline)◆ □	❋ G	R	G	R	R	G	
Metallic/Non-Metallic Line (with Tracer Wire)	❋ G	Y	G	Y	Y	G metallic	Y non-metallic
Metallic/Non-Metallic Line (without Tracer Wire)	G metallic	R non-metallic	R	❋ G	Y	Y	G metallic	R non-metallic
Metal or Fiberglass UST	R	R	❋ G	R	R	G metallic	R non-metallic

Additional Considerations

Technology ⇒ Variable ⇓	Radio Frequency Electro-Magnetic Detector	Ground Penetrating Radar (GPR)⊙	Acoustic Pipe Locator	Beacon, Sonde, or Conductive Rodder Insertion	EM-61 Ξ
Moist Soil	G	Y	G	G	G
Dry Soil	Y	G	Y	G	G
Clay	Y	R	G	G	G
Concrete w/Rebar	R	Y	G	G	R
Long Horizontal Profile	G	G	G	G	G
Short Horizontal but Deep Vertical Profile	Y	G	R	R	G
Access to Line✚	G	N/A	G	G	G
No Access to Line✚	G (induction or passive)	G	R	R	G
	R (direct connect)				G
Ferrous Metal	G	G	G	G	G
Non-ferrous Metal	Y	G	G	G	G
Adjacent or crossing conductive utility(ies)	Y	N/A	N/A	N/A	Y

Each site will be unique. Do not use this table as the sole criteria for technology selection. Use it as a starting point to assess available, applicable technology(s).

❋ Indicates best technology for given object. Site structures, rebar in concrete, shallow groundwater tables, perched storm water, etc. can significantly affect performance and reliability of any electro/magnetic method. Other utilities which cross or are adjacent to the target line can cause the EM signal to bleed or jump to the other utility line.

□ Metallic lines that have power running through them or can be connected to a tracer signal generator.

◆ Natural gas pipeline locating technicians must be trained/certified (in the U.S. requires DOT and Office of Pipeline Safety standards, other regions may have similar certification or requirements).

⊙ Most sensitive to interpretation. The skill, training and experience of operator are critical.

Ξ Emerging technology with limited availability.

✚ Access: induce unique electronic signature, apply acoustical impulse or insert conductive rodder/beacon/sonde.

Green Generally, an applicable technology **Yellow** May or may not be applicable **Red** Not generally applicable

APPENDIX F

Heavy Equipment Exclusion Zone Policy

HEAVY EQUIPMENT EXCLUSION ZONE MANAGEMENT PROGRAM

CORPORATE HEALTH AND SAFETY DIRECTOR	:	**Brian Hobbs, CIH, CSP**
EFFECTIVE DATE	:	**01/2019**
REVIEWED DATE	:	**03/2025**
REVISION NUMBER	:	**4**

TABLE OF CONTENTS

1. PURPOSE 1
2. SCOPE AND APPLICABILITY 1
3. PROCEDURES 1
   3.1 Exceptions 2
4. TRAINING 2
5. STOP WORK AUTHORITY 2

1. PURPOSE

The Exclusion Zone Management Program aims to establish the minimum clearance distance that must be maintained between workers and heavy equipment while the equipment is in operation (i.e., engaged or in motion). The intent is to have no personnel or equipment entering the Exclusion Zone while the equipment is in operation or moving to ensure that Roux and Subcontractor employees are unnecessarily exposed to the hazards of the equipment.

2. SCOPE AND APPLICABILITY

This Management Program applies to all Roux Associates, Inc. and its affiliated companies, Roux Environmental Engineering and Geology, D.P.C., and Remedial Engineering (collectively, "Roux") employees and their subcontractors performing fieldwork and are potentially exposed to heavy equipment. Heavy equipment includes, but is not necessarily limited to, excavation equipment, drill rigs, vacuum trucks, forklifts, lull telehandlers, man lifts, bobcats, delivery trucks, etc.

3. PROCEDURES

As specified in the following sections of this program, Exclusion Zones must be established and maintained during activities involving the movement/operation of heavy equipment. The Exclusion Zone requirements apply to all personnel on the site but are primarily focused on personnel required to work near the equipment. The exclusion zone is in effect when heavy equipment is moving or engaged (e.g., movement of an arm or bucket of an excavator, rotation of an auger, lifting of a load with a forklift, raising/lowering of a man lift, etc.).

1. The Exclusion Zone must meet the following minimum requirements:
   - A minimum distance of 10 feet from all heavy equipment and loads being moved by the equipment;
   - Greater than the swing/reach radius of any moving part on the heavy equipment (i.e., for large equipment, this may mean an exclusion zone distance larger than 20 feet);
   - Greater than the fall zone of equipment and their contents; and
   - Greater than the tip-over distance of the heavy equipment.

   The size of the Exclusion Zone will need to be determined on a task-specific basis considering the size of the heavy equipment in use and the task being performed. Prior to all heavy equipment operations, the Exclusion Zone(s) distance must be specifically identified in the Job Planning Process and incorporated in the pre-job tailgate meeting with the subcontractor(s), including any updates to our Job Safety Analysis (JSA).
2. The spotter (or another authorized individual) is responsible for enforcing the Exclusion Zone and not conducting any other task. The spotter should be positioned immediately outside of the Exclusion Zone within a clear line of sight of the equipment operator. The spotter must signal the operator to stop work if anyone or anything has the potential to enter or compromise the Exclusion Zone. The operator should stop work if the spotter is not within their line of sight. If a spotter must be within the Exclusion Zone, they must be in a designated area outside the swing/tip radius, fall zone, line of fire of lifted loads, etc. If multiple pieces of equipment are being used, one spotter may be adequate so long as there is a clear line of sight and the spotter can control the zone(s). Radios would be required since hand signals would not be adequate if two pieces of equipment are in operation at the same time in the Exclusion Zone.

3. If an individual must enter the Exclusion Zone, the designated Spotter must signal the Equipment Operator to stop the equipment. Once the equipment is no longer moving (e.g., movement of an arm of an excavator is STOPPED, lifting of a load with a forklift STOPPED, raising/lowering of a man lift is STOPPED, etc.), the operator must bring the boom/arm to the ground ensuring a “Zero Energy State” and DISENGAGE THE CONTROLS and STOP and SIGNAL BY “SHOWING HIS HANDS.” This signal will indicate that it is safe for the person to enter the limits of the Exclusion Zone to perform the required activity. The equipment must remain completely stopped/disengaged until all personnel exited the Exclusion Zone's boundaries and the designated Spotter has signaled by “SHOWING HIS HANDS” to the Equipment Operator that it is safe to resume operations.
4. When entering the limits of the Exclusion Zone, personnel must, at a minimum:
    - Establish eye contact with the operator and approach the heavy equipment in a manner that is in direct line of sight to the Equipment Operator;
    - Never walk under any suspended loads or raised booms/arms of the heavy equipment; and
    - Identify a travel path free of Slip/Trip/Fall hazards.
5. The Exclusion Zone should be delineated using cones with orange snow fences or solid poles between the cones, barrels, tape, or other measures. For work in rights-of-way, rigid barriers, such as Jersey barriers or temporary chain link fences, should be used. For certain types of widespread or moving/mobile equipment operations, such delineation may not be practicable around equipment or individual work areas. In such instances, it is expected that the entire operation will be within a larger secure work area or that additional means will be utilized to ensure the security of the work zone.

All subcontractors who provide heavy equipment operations to field projects must implement a program that meets or exceeds the expectations described above, as well as any additional requirements that may be required on a client or site-specific basis. Logistics involving heavy equipment should be understood and discussed prior to the field event during the job planning phase.

3.1 Exceptions

It is recognized that certain heavy equipment activities may require personnel to work within the limits of the Exclusion Zone as specified in this program. Such activities may include certain excavation clearance tasks, drill crew activities, or construction tasks. However, any such activity must be pre-planned, emphasizing limiting the amount and potential exposure of any activity required within the zone. The critical safety steps to mitigate the hazards associated with working within the Exclusion Zone must be defined in the JSA and potentially other project-specific plans (i.e., critical lift plans, etc.), and approved by the Roux Project Principal (PP), Office Health and Safety Manager (OHSM) and client representative, if required, prior to implementation.

4. TRAINING

Many Roux projects have different requirements that are client-specific or site-specific in nature. However, all Roux employees are provided initial training, as well as annually thereafter, on our Heavy Equipment Exclusion Zone policy.

5. STOP WORK AUTHORITY

All Roux employees and their subcontractors have stop-work authority. Upon initial hire, all Roux employees are provided initial safety orientation, including stop work authority. All Roux employees and subcontractors are encouraged to stop work whenever any task or operation presents an unreasonable risk or employees

are unsure how to carry out work safely. This includes upon observing any questionable safety-related behavior or condition, they are to stop work immediately and discuss the behavior or condition with the individual(s) involved. Upon stopping work, the following actions will be taken:

- Notify the affected parties to include the Project Manager (PM) and Site Health and Safety Officer (SHSO);
- Work to correct the situation or not proceed until the situation is corrected by the PM or SHSO;
- Resume work only when told to proceed by either the PM or SHSO;
- The SHSO will document the Stop-Work intervention in the field logbook;
- Stop-Work interventions will be reported to the PP for review to ensure the interventions are closed; and
- The PP will share learnings from the interventions, as appropriate, throughout the firm, to demonstrate the importance of the Stop-Work interventions.

Please note: Any form of retribution or intimidation directed at any individual or company for exercising their right to issue a stop work authority will not be tolerated.