Crompco LLC
1815 Gallagher Rd
Plymouth Meeting, PA 19462

United Refining
Location #M0075

2440 West Ridge Road
Rochester, NY 14626
+1 585-225-3775

W-178984 Visit #181539 5/21/2026

Leak Detector

Equipment #	Grade	Pump Type	Result
005	Regular	Mechanical (MLLD)	Pass
006a	Premium (non-ethanol)	Mechanical (MLLD)	Pass
006b	Premium	Mechanical (MLLD)	Pass

Precision Line Tightness Test

Equipment #	Grade	Result
005	Regular	Pass
006a	Premium (non-ethanol)	Pass
006b	Premium	Pass

UST / AST Monitor

Form Name	Result
UST / AST Monitor	Pass

Keon Cardwell



Christopher Coles

MECHANICAL AND ELECTRONIC LINE LEAK DETECTORS PERFORMANCE TESTS

Facility Name: Kwik Fill			Owner: United Refining			
Address: 2440 West Ridge Road			Address:			
City, State, Zip Code: Rochester NY 14626			City, State, Zip Code:			
Facility I.D. #: 8-026026			Phone #: 5852253775			
Testing Company: Owl Services USA			Phone #: 800-646-3161		Date: 5/21/2026	
This data sheet can be used to test mechanical line leak detectors (MLLD) and electronic line leak detectors (ELLD) with submersible turbine pump (STP) systems. See PEI/RP1200 Sections 9.1 and 9.2 for test procedures.						
Line Number	005	006a	006b			
Product Stored	Regular	Premium	Premium			
Leak Detector Manufacturer	Veeder	Veeder	Red Jacket			
Leak Detector Model	FX1V	FX1V	FX1V			
Type of Leak Detector	☑ MLLD ☐ ELLD	☑ MLLD ☐ ELLD	☑ MLLD ☐ ELLD	☐ MLLD ☐ ELLD	☐ MLLD ☐ ELLD	☐ MLLD ☐ ELLD
MLLD (ALL PRESSURE MEASUREMENTS ARE MADE IN PSIG)						
STP Full Operating Pressure	30	30	30			
Check Valve Holding Pressure	19	20	18			
Line Resiliency (ml) (line bleed back volume as measured from check valve holding pressure to 0 psig)	272.55	242.27	272.55			
Step Through Time in Seconds (time the MLLD hesitates at metering pressure before going to full operating pressure as measured from 0 psig with no leak induced on the line)	3	2	3			
Metering Pressure (STP pressure when simulated leak rate 3 gph at 10 psig)	10	10	10			
Opening Time in Seconds (the time the MLLD opens to allow full pressure after simulated leak is stopped)	3	2	3			
Does the STP pressure remain at or below the metering pressure for at least 60 seconds when the simulated leak is induced?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Does the leak detector reset (trip) when the line pressure is bled off to zero psig?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Does the STP properly cycle on/off under normal fuel system operation conditions?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
A "No" answer to either of the above questions indicates the MLLD fails the test.						
ELLD (ALL PRESSURE MEASUREMENTS ARE MADE IN PSIG)						
STP Full Operating Pressure						
How many test cycles are observed before alarm/shutdown occurs?						
Does the simulated leak cause an alarm?	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
A "No" answer to the above question indicates the ELLD fails the test.						
Does the simulated leak cause an STP shutdown?	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA
Test Results	☒ Pass ☐ Fail	☒ Pass ☐ Fail	☒ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail

Comments: Testing was conducted in accordance with PEI/RP1200

Tester Signature: Chris Coles

Tester Name: Christopher Coles

Kwik Fill
2440 West Ridge Road
Rochester
NY 14626

Purpora Engineering
Petro-Tite Line Tightness Test Form

Work Visit # 181539
UST Registration #
8-026026

IDENTIFY EACH LINE AS TESTED	TIME (MILITARY)	LOG OF TEST PROCEDURES, AMBIENT TEMPERATURE, WEATHER, ETC.	PRESSURE PSI BEFORE	PRESSURE PSI AFTER	VOLUME READING BEFORE	VOLUME READING AFTER	VOLUME NET CHANGE	REMARKS SIZE, LENGTH & TYPE OF LINE, #FLEX CONNECTORS, CONCLUSIONS
005	07:30	Connected line tester to: Shear						
Regular	08:00	Started line test		60		.001		
	08:10	Line Test Continued	60	60	.001	.001	0	
	08:20	Line Test Continued	60	60	.001	.001	0	
	08:30	Line Test Continued	60	60	.001	.001	0	
	08:40	Bleed Back	60	0	.001	.032	0.031	

Material Fiberglass

Wall Type Double

Line Length (feet) 90

Diameter (inches) 2

Pressure/Suction Pressure

Allowable Bleedback

(PL x Ba) + (FC x Bb(.006)) + B(.05) = N

(90 * 0)
+ (0 * 0.006) + 0.05 = 0.05

Tests were made on the above line systems in accordance with test procedures prescribed for as detailed on attached test charts with the results as follows:

Line Identification	Meets Criteria (Yes/No)	Net Volume Change Per Hour	Date Tested
005 Regular	Yes	0	5/21/2026

CONTRACTOR CERTIFICATION

Technician:
Christopher Coles

0b7633ae
Certification # _____

Notes:

Kwik Fill
2440 West Ridge Road
Rochester
NY 14626

Purpora Engineering
Petro-Tite Line Tightness Test Form

Work Visit # 181539
UST Registration #
8-026026

IDENTIFY EACH LINE AS TESTED	TIME (MILITARY)	LOG OF TEST PROCEDURES, AMBIENT TEMPERATURE, WEATHER, ETC.	PRESSURE PSI BEFORE	PRESSURE PSI AFTER	VOLUME READING BEFORE	VOLUME READING AFTER	VOLUME NET CHANGE	REMARKS SIZE, LENGTH & TYPE OF LINE, #FLEX CONNECTORS, CONCLUSIONS
006a	07:32	Connected line tester to: Shear						
Premium	08:02	Started line test		60		.001		
	08:12	Line Test Continued	60	60	.001	.001	0	
	08:22	Line Test Continued	60	60	.001	.001	0	
	08:32	Line Test Continued	60	60	.001	.001	0	
	08:42	Bleed Back	60	0	.001	.022	0.021	

Material Fiberglass

Wall Type Double

Line Length (feet) 60

Diameter (inches) 2

Pressure/Suction Pressure

Allowable Bleedback

(PL x Ba) + (FC x Bb(.006)) + B(.05) = N

(60 * 0)
+ (0 * 0.006) + 0.05 = 0.05

Tests were made on the above line systems in accordance with test procedures prescribed for as detailed on attached test charts with the results as follows:

Line Identification	Meets Criteria (Yes/No)	Net Volume Change Per Hour	Date Tested
006a Premium	Yes	0	5/21/2026

CONTRACTOR CERTIFICATION

Technician:
Christopher Coles

0b7633ae
Certification # _____

Notes:

Kwik Fill
2440 West Ridge Road
Rochester
NY 14626

Purpora Engineering
Petro-Tite Line Tightness Test Form

Work Visit # 181539
UST Registration #
8-026026

IDENTIFY EACH LINE AS TESTED	TIME (MILITARY)	LOG OF TEST PROCEDURES, AMBIENT TEMPERATURE, WEATHER, ETC.	PRESSURE PSI BEFORE	PRESSURE PSI AFTER	VOLUME READING BEFORE	VOLUME READING AFTER	VOLUME NET CHANGE	REMARKS SIZE, LENGTH & TYPE OF LINE, #FLEX CONNECTORS, CONCLUSIONS
006b	07:34	Connected line tester to: Shear						
Premium	08:04	Started line test		60		.001		
	08:14	Line Test Continued	60	60	.001	.001	0	
	08:24	Line Test Continued	60	60	.001	.001	0	
	08:34	Line Test Continued	60	60	.001	.001	0	
	08:44	Bleed Back	60	0	.001	.026	0.025	

Material Fiberglass

Wall Type Double

Line Length (feet) 100

Diameter (inches) 2

Pressure/Suction Pressure

Allowable Bleedback

(PL x Ba) + (FC x Bb(.006)) + B(.05) = N

(100 * 0)
+ (0 * 0.006) + 0.05 = 0.05

Tests were made on the above line systems in accordance with test procedures prescribed for as detailed on attached test charts with the results as follows:

Line Identification	Meets Criteria (Yes/No)	Net Volume Change Per Hour	Date Tested
006b Premium	Yes	0	5/21/2026

CONTRACTOR CERTIFICATION

Technician:
Christopher Coles

0b7633ae
Certification # _____

Notes:

AUTOMATIC TANK GAUGE OPERATION INSPECTION

Facility Name: Kwik Fill		Owner: United Refining	
Address: 2440 West Ridge Road		Address:	
City, State, Zip Code: Rochester NY 14626		City, State, Zip Code:	
Facility I.D. #: 8-026026		Phone #: 5852253775	
Testing Company: Owl Services USA		Phone #: 800-646-3161	Date: 5/21/2026

This procedure is to determine whether the automatic tank gauge (ATG) is operating properly. See PEI/RP1200 Section 8.2 for the inspection procedure. This procedure is applicable to tank level monitor probes that touch the bottom of the tank when in place.

Tank Number	005	006A	006b	
Product Stored	Regular	Premium (non-	Premium	
ATG Brand and Model	Veeder Root TLS-450	Veeder Root TLS-450	Veeder Root TLS-450	
1. Tank Volume, gallons	10027	5013	5013	
2. Tank Diameter, inches	96	96	96	
3. The ATG probe was removed from the tank and inspected for damage and residual buildup.	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No
4. Float moves freely on the stem without binding?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No
5. Fuel float level agrees with the value programmed into the console?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No
6. Water float level agrees with the value programmed into the console?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No
7. Inch level from bottom of probe when 90% alarm is triggered.	81	81	81	
8. Inch level at which the overfill alarm activates corresponds with value programmed in the gauge?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No
9. Inch level from the bottom when the water float first triggers an alarm.	2	2	2	
10. Inch level at which the water float alarm activates corresponds with value programmed in the gauge?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No
If any answers in Lines 3, 4, 5, or 6 are "No," the system has failed the test.				
If internal ATG battery backup is present, was it functional per manufacturer's specifications. ☑ Yes ☐ No ☐ None				
Test Results	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☐ Pass ☐ Fail

Comments:

Tester's Name (print) Christopher Coles

Tester's Signature



LIQUID SENSOR FUNCTIONALITY TESTING

Facility Name: Kwik Fill				Owner: United Refining			
Address: 2440 West Ridge Road				Address:			
City, State, Zip Code: Rochester NY 14626				City, State, Zip Code:			
Facility I.D. #: 8-026026				Phone #: 5852253775			
Testing Company: Owl Services USA				Phone #: 800-646-3161		Date: 5/21/2026	
This procedure is to determine whether liquid sensors located in the interstitial space of UST systems are able to detect the presence of water and fuel. See PEI/ RP1200 Section 8.3 for the test procedure.							
Sensor Location	005 STP Sump	006A STP Sump	006b STP Sump				
Product Stored	Regular	Premium	Premium				
Type of Sensor	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating
Test Liquid	☑ Water ☐ Product	☑ Water ☐ Product	☑ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product
Is the ATG console clear of any active alarms regarding any leak sensors? If the sensor is in alarm and functioning, indicate why.	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Is the sensor alarm circuit operational?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Has sensor been inspected and in good operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When placed in the test liquid, does the sensor trigger an alarm?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When an alarm is triggered, is the sensor properly identified on the ATG console?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Any "No" answers indicates a test failure.							
Test Results	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail
Comments:							

Tester's Name (print) Christopher Coles Tester's Signature Chris Cole

LIQUID SENSOR FUNCTIONALITY TESTING

Facility Name: Kwik Fill				Owner: United Refining			
Address: 2440 West Ridge Road				Address:			
City, State, Zip Code: Rochester NY 14626				City, State, Zip Code:			
Facility I.D. #: 8-026026				Phone #: 5852253775			
Testing Company: Owl Services USA				Phone #: 800-646-3161		Date: 5/21/2026	

This procedure is to determine whether liquid sensors located in the interstitial space of UST systems are able to detect the presence of water and fuel. See PEI/RP1200 Section 8.3 for the test procedure.

Sensor Location	005 Tank Interstitial	006b Tank Interstitial					
Product Stored	Regular	Premium					
Type of Sensor	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating
Test Liquid	☑ Water ☐ Product	☑ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product
Is the ATG console clear of any active alarms regarding any leak sensors? If the sensor is in alarm and functioning, indicate why.	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Is the sensor alarm circuit operational?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Has sensor been inspected and in good operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When placed in the test liquid, does the sensor trigger an alarm?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When an alarm is triggered, is the sensor properly identified on the ATG console?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Any "No" answers indicates a test failure.							
Test Results	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail

Comments:

Tester's Name (print) Christopher Coles Tester's Signature Chris Cole

LIQUID SENSOR FUNCTIONALITY TESTING

Facility Name: Kwik Fill	Owner: United Refining	
Address: 2440 West Ridge Road	Address:	
City, State, Zip Code: Rochester NY 14626	City, State, Zip Code:	
Facility I.D. #: 8-026026	Phone #: 5852253775	
Testing Company: Owl Services USA	Phone #: 800-646-3161	Date: 5/21/2026

This procedure is to determine whether liquid sensors located in the interstitial space of UST systems are able to detect the presence of water and fuel. See PEI/RP1200 Section 8.3 for the test procedure.

Sensor Location	Dispenser 1/2	Dispenser 3/4					
Product Stored	Regular, Premium	Regular, Premium, Ethanol-Free					
Type of Sensor	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating
Test Liquid	☑ Water ☐ Product	☑ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product
Is the ATG console clear of any active alarms regarding any leak sensors? If the sensor is in alarm and functioning, indicate why.	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Is the sensor alarm circuit operational?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Has sensor been inspected and in good operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When placed in the test liquid, does the sensor trigger an alarm?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When an alarm is triggered, is the sensor properly identified on the ATG console?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Any "No" answers indicates a test failure.							
Test Results	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail

Comments:

Tester's Name (print) Christopher Coles Tester's Signature 


Images



IMG_3433.jpeg



IMG_3434.jpeg

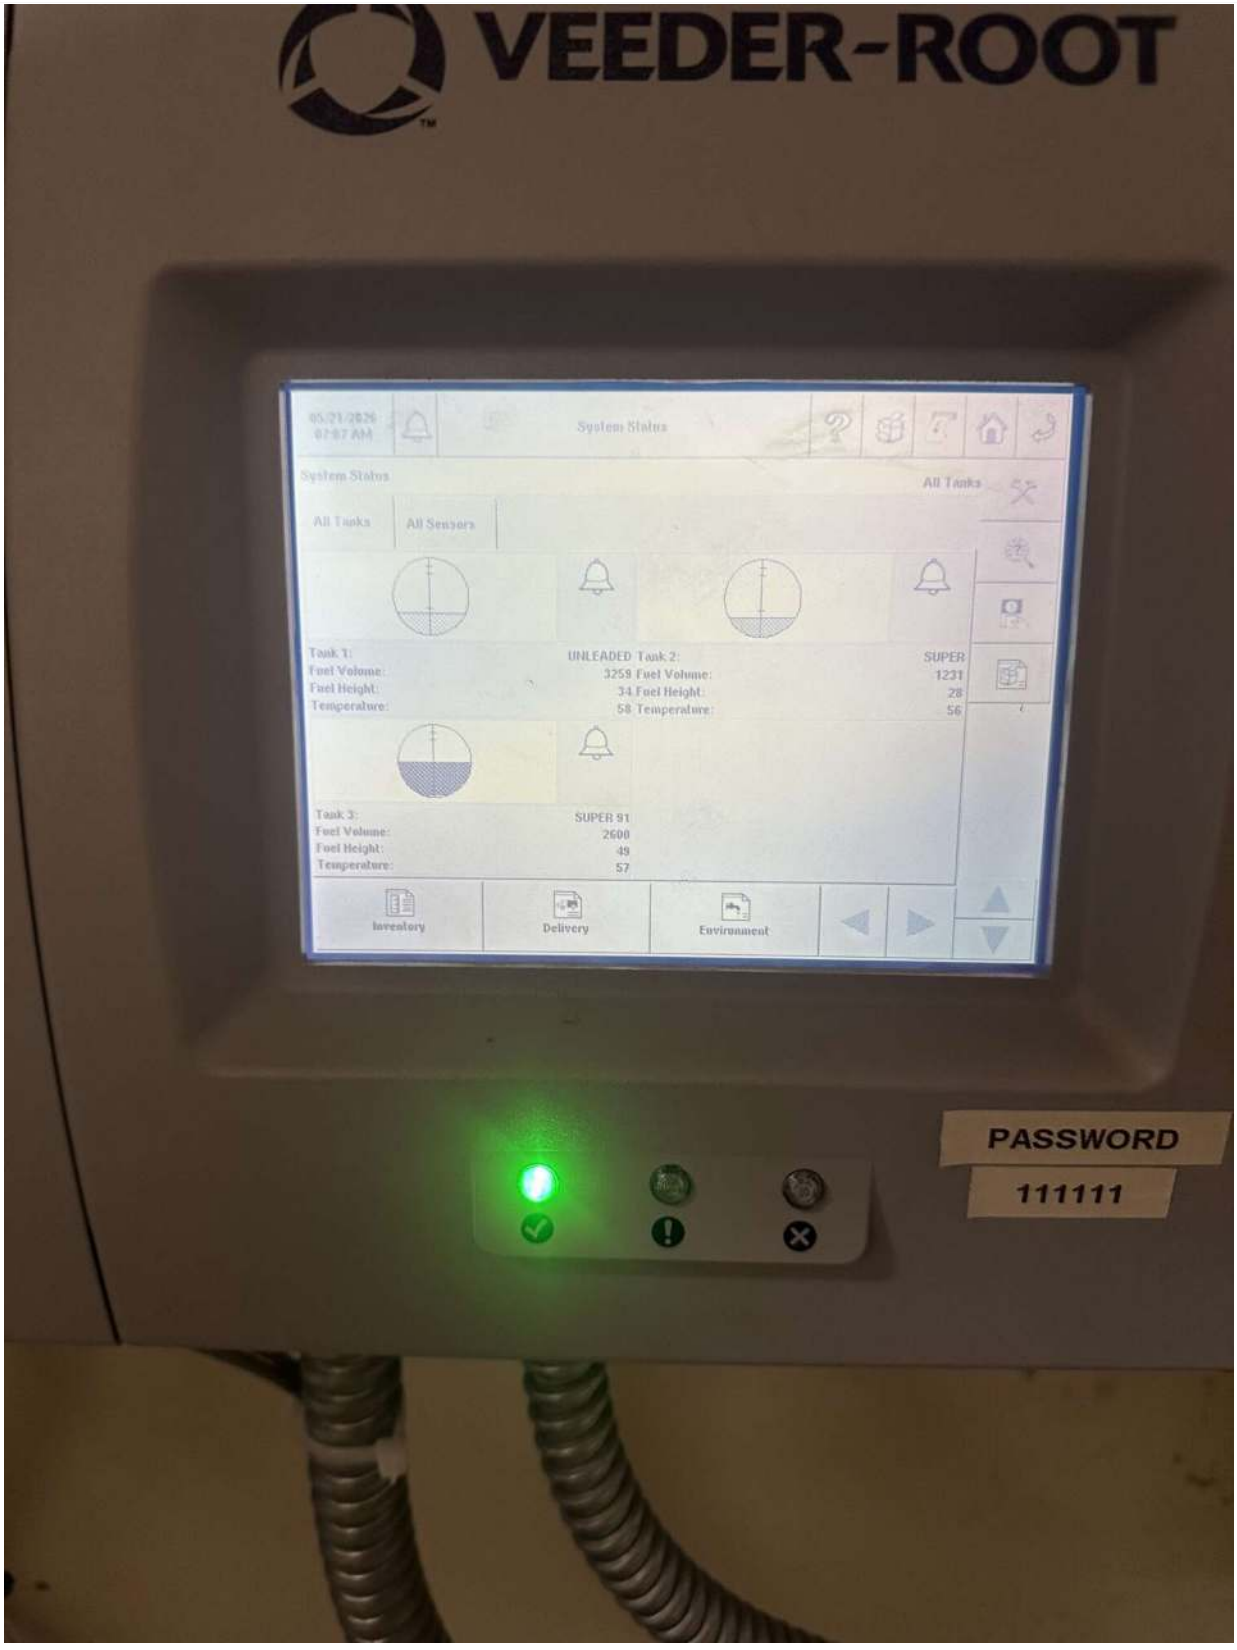

IMG_3435.jpeg




IMG_3437.jpeg



IMG_3439.jpeg



IMG_3440.jpeg

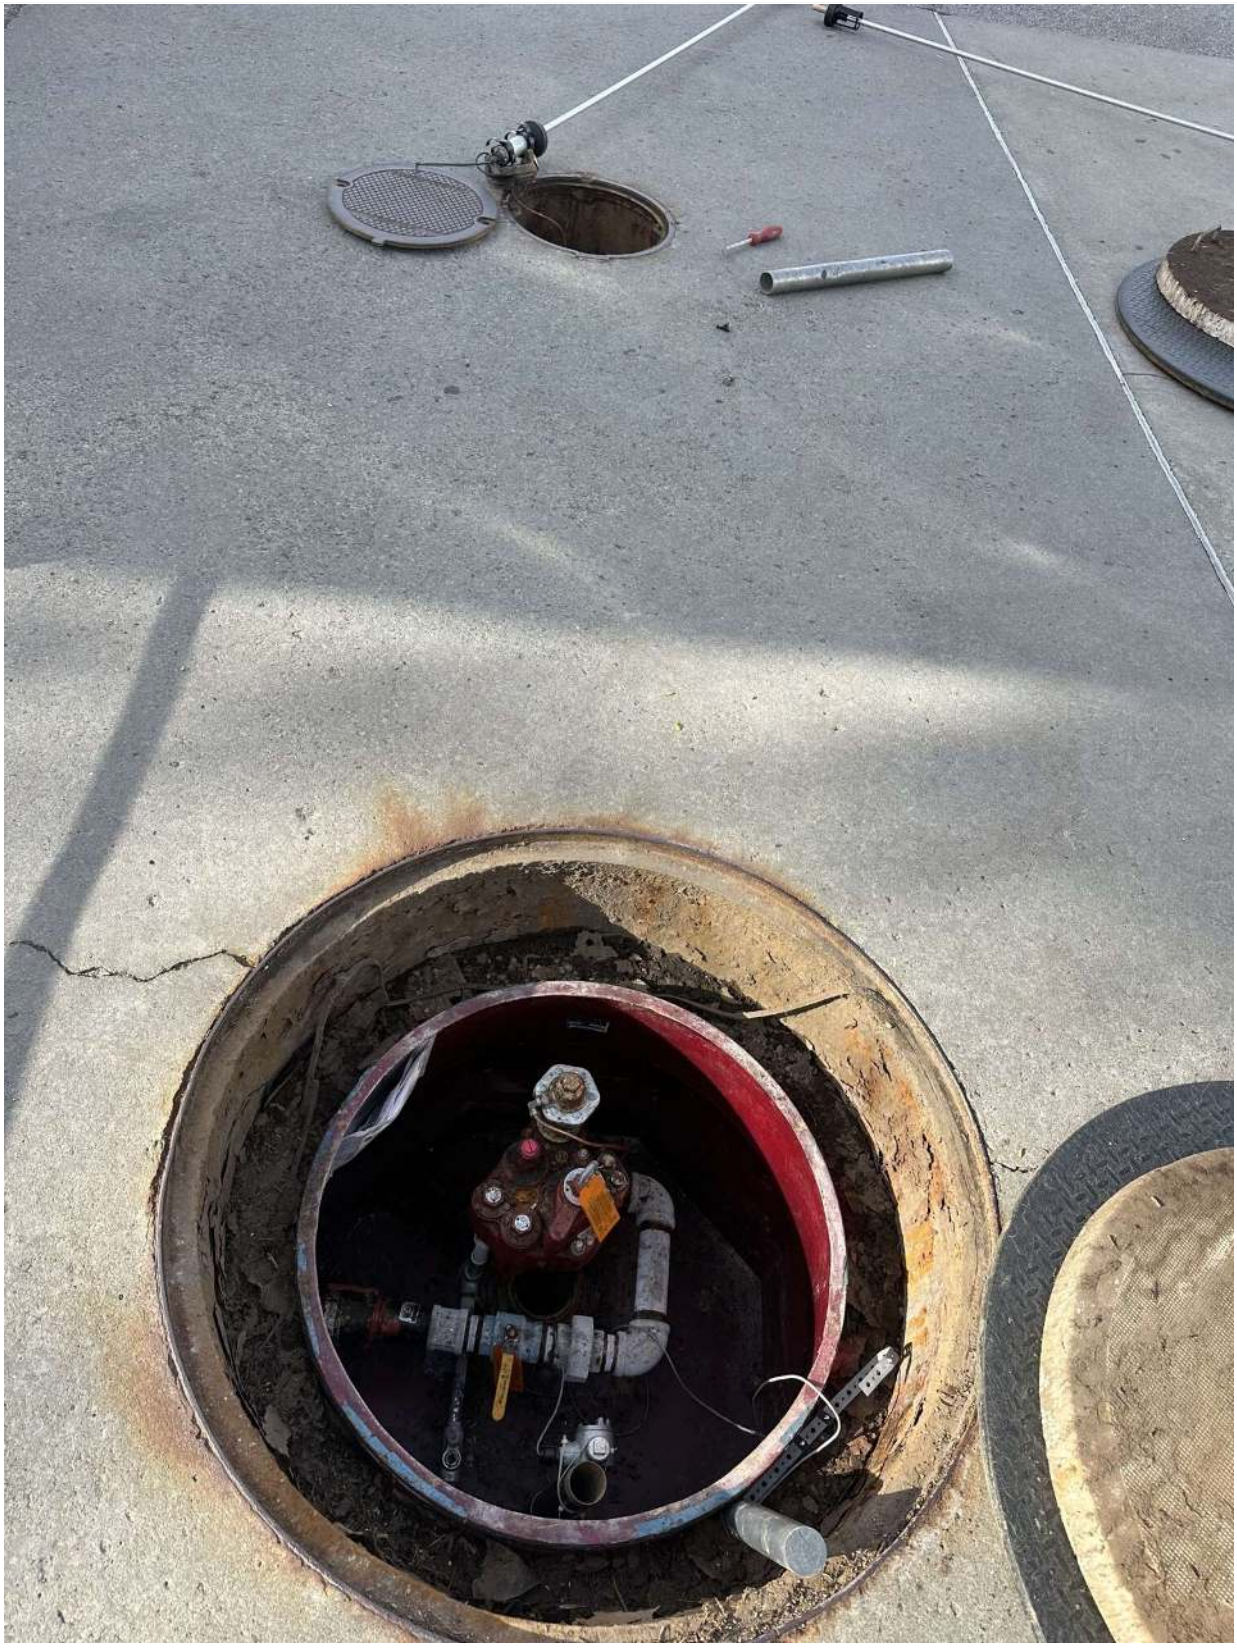

IMG_3441.jpeg



IMG_3442.jpeg



IMG_3443.jpeg



IMG_3444.jpeg




IMG_3445.jpeg


Crompco LLC
1815 Gallagher Rd
Plymouth Meeting, PA 19462

United Refining
Location #M0075

2440 West Ridge Road
Rochester, NY 14626
+1 585-225-3775

Diagram - Kwik Fill (v1)

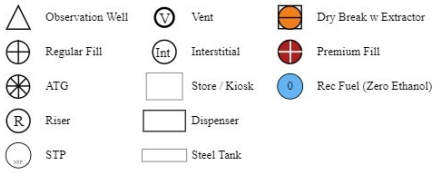

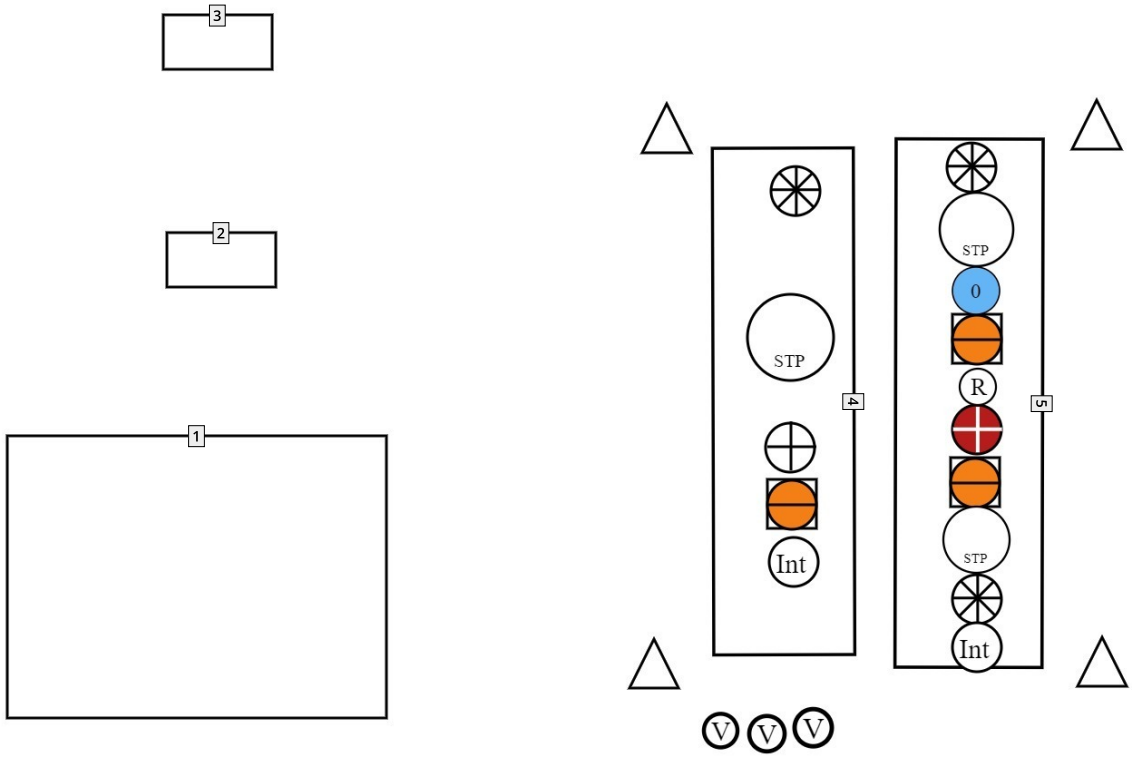

1: Store / Kiosk - Kwik fill
2: Dispenser - 1/2
3: Dispenser - 3/4
4: Steel Tank - Regular
5: Steel Tank - Premium / Ethanol free

Visit Verification

CUSTOMER
United Refining

LOCATION
#M0075
2440 West Ridge Road
Rochester, NY 14626

CONTACT
United Refining Company of PA

SCHEDULED
05/21/2026 12:00am (EDT)

ASSIGNED TO
Keon Cardwell, Christopher Coles

SERVICE REASON
Compliance

PRODUCTS & SERVICES

Item	Qty
Combos	
All Lines and Leak Detectors	3.00
Expenses	
Fuel Surcharge	1.00
Services	
Monitor System Inspection Automatic Tank Gauging System / Monitor System Inspection	1.00

CONFIRMATION
By signing this verification you are agreeing that we have performed and/or provided services and parts listed above.

Approver's Name
N/A

Email

Signature Status
Nobody available to sign