Crompco LLC
1815 Gallagher Rd
Plymouth Meeting, PA 19462

7-Eleven Stores, Inc
Location #45103

185 North Exchange Street
Geneva, NY 14456
+1 315-781-2248

W-190540 Visit #193125 6/15/2026

Leak Detector			
Equipment #	Grade	Pump Type	Result
006A	Diesel	Electronic (ELLD)	Pass

Precision Line Tightness Test		
Equipment #	Grade	Result
006A	Diesel	Pass



Tyzay McClinton



Thomas Grinder

MECHANICAL AND ELECTRONIC LINE LEAK DETECTORS
PERFORMANCE TESTS

Facility Name: Speedway			Owner: 7-Eleven Stores, Inc			
Address: 185 North Exchange Street			Address:			
City, State, Zip Code: Geneva NY 14456			City, State, Zip Code:			
Facility I.D. #: 8-136425			Phone #: 3157812248			
Testing Company: Owl Services USA			Phone #: 800-646-3161		Date: 6/15/2026	
This data sheet can be used to test mechanical line leak detectors (MLLD) and electronic line leak detectors (ELLD) with submersible turbine pump (STP) systems. See PEI/RP1200 Sections 9.1 and 9.2 for test procedures.						
Line Number	006A					
Product Stored	Diesel					
Leak Detector Manufacturer	Franklin					
Leak Detector Model	TS-LS500					
Type of Leak Detector	☐ MLLD ☑ ELLD	☐ MLLD ☐ ELLD	☐ MLLD ☐ ELLD	☐ MLLD ☐ ELLD	☐ MLLD ☐ ELLD	☐ MLLD ☐ ELLD
MLLD (ALL PRESSURE MEASUREMENTS ARE MADE IN PSIG)						
STP Full Operating Pressure						
Check Valve Holding Pressure						
Line Resiliency (ml) (line bleed back volume as measured from check valve holding pressure to 0 psig)						
Step Through Time in Seconds (time the MLLD hesitates at metering pressure before going to full operating pressure as measured from 0 psig with no leak induced on the line)						
Metering Pressure (STP pressure when simulated leak rate 3 gph at 10 psig)						
Opening Time in Seconds (the time the MLLD opens to allow full pressure after simulated leak is stopped)						
Does the STP pressure remain at or below the metering pressure for at least 60 seconds when the simulated leak is induced?	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Does the leak detector reset (trip) when the line pressure is bled off to zero psig?	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Does the STP properly cycle on/off under normal fuel system operation conditions?	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
A "No" answer to either of the above questions indicates the MLLD fails the test.						
ELLD (ALL PRESSURE MEASUREMENTS ARE MADE IN PSIG)						
STP Full Operating Pressure	33					
How many test cycles are observed before alarm/shutdown occurs?	23					
Does the simulated leak cause an alarm?	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
A "No" answer to the above question indicates the ELLD fails the test.						
Does the simulated leak cause an STP shutdown?	☑ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA
Test Results	☒ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail

Comments: Testing was conducted in accordance with PEI/RP1200

Tester Signature: Thomas Grinder

Tester Name: Thomas Grinder

Speedway
185 North Exchange Street
Geneva
NY 14456

Purpora Engineering
Petro-Tite Line Tightness Test Form

Work Visit # 193125
UST Registration #
8-136425

IDENTIFY EACH LINE AS TESTED	TIME (MILITARY)	LOG OF TEST PROCEDURES, AMBIENT TEMPERATURE, WEATHER, ETC.	PRESSURE PSI BEFORE	PRESSURE PSI AFTER	VOLUME READING BEFORE	VOLUME READING AFTER	VOLUME NET CHANGE	REMARKS SIZE, LENGTH & TYPE OF LINE, #FLEX CONNECTORS, CONCLUSIONS
006A	13:58	Connected line tester to: Shear						
Diesel	14:00	Started line test		50		.050		
	14:10	Line Test Continued	50	50	.050	.050	0	
	14:20	Line Test Continued	50	50	.050	.050	0	
	14:30	Line Test Continued	50	50	.050	.050	0	
	14:30	Bleed Back	50	0	.050	.1	0.05	

Material Fiberglass

Wall Type Double

Line Length (feet) 50

Diameter (inches) 2

Pressure/Suction Pressure

Allowable Bleedback

(PL x Ba) + (FC x Bb(.006)) + B(.05) = N

(50 * 0)
+ (0 * 0.006) + 0.05 = 0.05

Tests were made on the above line systems in accordance with test procedures prescribed for as detailed on attached test charts with the results as follows:

Line Identification	Meets Criteria (Yes/No)	Net Volume Change Per Hour	Date Tested
006A Diesel	Yes	0	6/15/2026

CONTRACTOR CERTIFICATION

Technician:
Thomas Grinder

f5b88a3d

Certification # _____


Notes:

Crompco LLC
1815 Gallagher Rd
Plymouth Meeting, PA 19462

7-Eleven Stores, Inc
Location #45103

185 North Exchange Street
Geneva, NY 14456
+1 315-781-2248

Diagram - Site Diagram (v2)

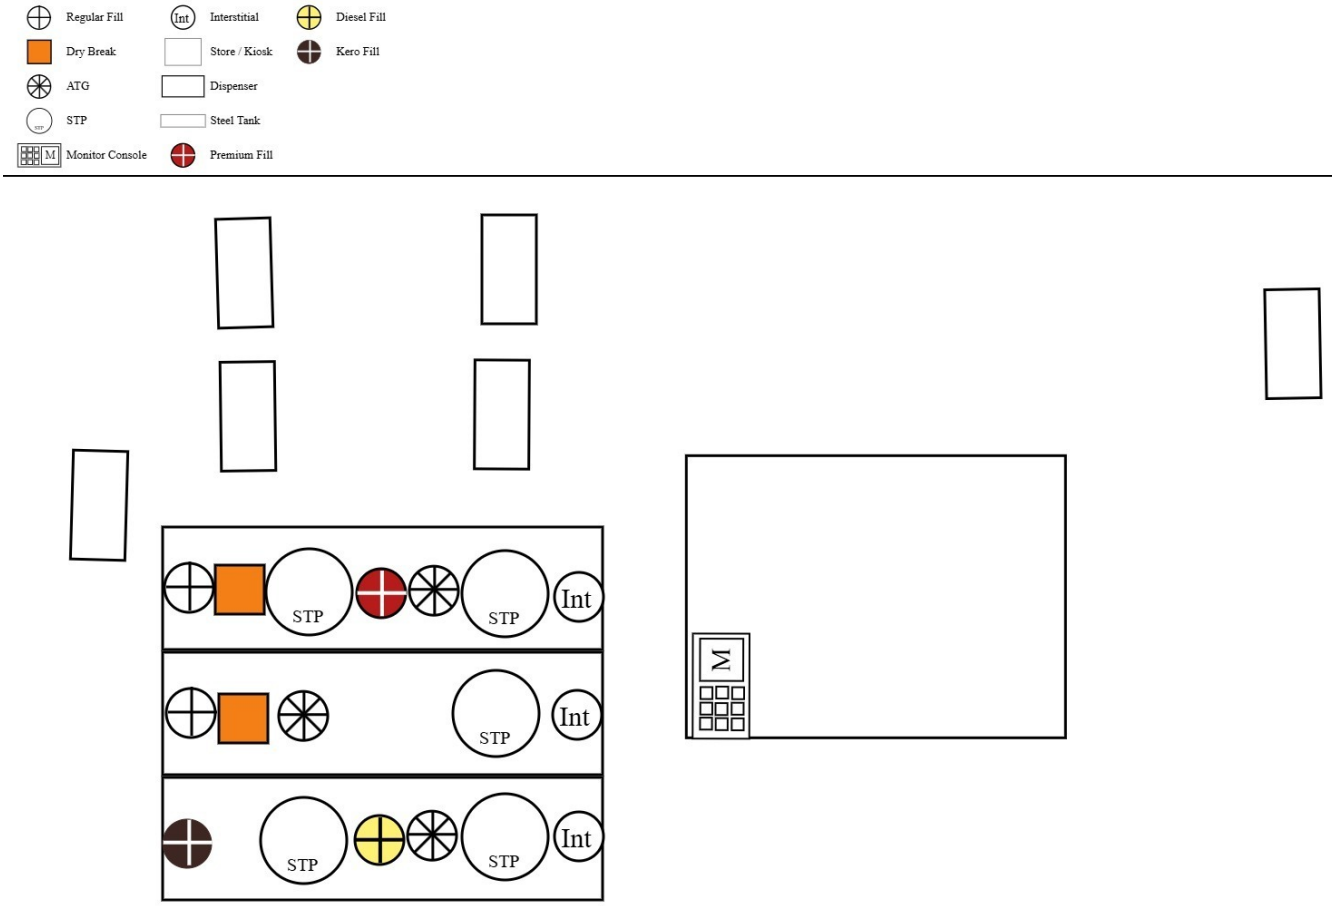

Visit Verification

CUSTOMER
7-Eleven Stores, Inc

LOCATION
#45103
185 North Exchange Street
Geneva, NY 14456

CONTACT
7-Eleven Stores, Inc

SCHEDULED
06/15/2026 12:00am (EDT)

ASSIGNED TO
Tyzay McClinton, Thomas Grinder

SERVICE REASON
Compliance Retest

PRODUCTS & SERVICES

Item	Qty
Combos	
Diesel Lines and Leak Detectors	1.00
Expenses	
Fuel Surcharge	1.00
MINIMUM SITE CHARGE	1.00

CONFIRMATION
By signing this verification you are agreeing that we have performed and/or provided services and parts listed above.

Approver's Name
Charlene Worley

Email

Signature Status
Nobody available to sign