Emergency Stop

Equipment #	Location	Result
1	Behind Counter	Pass
2	Outside Wall of Building	

Federal Stage I Pressure Decay 2-inch

Form Name	Result
Federal Stage I Pressure Decay 2-inch	Pass
Federal Stage I Pressure Decay 2-inch	Pass

Leak Detector

Equipment #	Grade	Pump Type	Result
005	Regular	Mechanical (MLLD)	Pass
006A	Premium	Mechanical (MLLD)	Pass
006B	Diesel	Mechanical (MLLD)	Pass

Overfill

Equipment #	Grade	Overfill Type	Result
005	Regular	Overfill Drop Tube	Pass
006A	Premium	Overfill Drop Tube	Pass
006B	Diesel	Overfill Drop Tube	Pass

PV Valve

Equipment #	Make	Model	Result
005	OPW	623V	Pass
006A	OPW	623V	

Precision Line Tightness Test

Equipment #	Grade	Result
005	Regular	Pass
006A	Premium	Pass
006B	Diesel	Pass

Shear Valve

Form Name	Result
Shear Valve	Pass

UST / AST Monitor

Form Name	Result
UST / AST Monitor	Pass

Tyzay McClinton

Thomas Grinder

EMERGENCY STOP SWITCH OPERATION INSPECTION

Facility Name: 7-Eleven 35080		Owner: 7-Eleven Stores, Inc	
Address: 1283 Route 332		Address:	
City, State, Zip Code: Farmington NY 14425		City, State, Zip Code:	
Facility I.D. #: 8-390364		Phone #: 5859244569	
Testing Company: Owl Services USA		Phone #: 610-278-7203	Date: 6/16/2026

This procedure is to verify the operation of all emergency stop switches/buttons (E-stops). Each E-stop must disconnect power to dispensers, submersible turbine pumps (STPs) and all non-intrinsically safe electrical equipment in classified areas. Test each E-stop separately. See PEI/RP1200 Section 11 for the inspection procedure.

E-stop Number or ID	1	2				
Location	Behind Counter	Outside Wall of Building				
1. E-stops labeled and located where easily accessible?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
2. System fully powered and in normal operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
3. After activating E-stop, power disconnected from:						
3a. All dispensing devices on all islands?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
3b. All STPs for all fuel grades?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
3c. All power, control and signal circuits associated with the dispensing devices and the STPs?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
3d. All other non-intrinsically safe electrical equipment in classified areas surrounding fuel dispensing devices?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
4. All intrinsically safe electrical equipment remains energized after E-stop activation?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
5. After testing, E-stop has been reset and power reestablished to normal operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
A "No" to lines 3a-3d indicates a test failure.						
Test Results	✓ Pass Fail	✓ Pass Fail	Pass Fail	Pass Fail	Pass Fail	Pass Fail

Comments:

Testing was conducted in accordance with PEI/RP1200

Thomas Grinder

Tester's Name (print) _____ Tester's Signature _____

1	Behind Counter
2	Outside Wall of Building

Pressure Decay Test

Stage 1 Type	Last Fuel Delivery	Is a swivel/rotatable or locking clamp style equipment installed on all gasoline fill ports?	Is a swivel/rotatable or locking clamp style equipment installed on all gasoline Stage 1 Vapor Adapters?
☐ Co-Axial ☑ Dual Point ☐ Combination Are tanks manifolded in the vapor space? ☐ Yes ☑ No	Date & Time [1] 06/12/2026 12:00pm	☑ Yes ☐ No	☑ Yes ☐ No

Pressure Decay Test Results

Tank Number	005				Total
1. Product Grade	Regular				
2. Distance of Drop Tube from Tank Bottom (*inches*)	4				
3. Actual Tank Capacity *(gallons)*	19782				
4. Gasoline Volume *(gallons)*	9408				
5. Ullage [2] *(gallons)* (Ullage = Line #4 – Lines #5)	10374				
Start Time of Test	06/16/2026 12:00pm				
6. Initial Pressure *(inches H_2O)*	2.00				
7. Pressure After 1 Minute *(inches H_2O)*	2				
8. Pressure After 2 Minutes *(inches H_2O)*	2				
9. Pressure After 3 Minutes *(inches H_2O)*	2				
10. Pressure After 4 Minutes *(inches H_2O)*	2				
11. Pressure After 5 Minutes *(inches H_2O)*	2				
12. Allowable Pressure [3] *(inches H_2O)*	1.9057				
Result	☑ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	

Comments

UST Registration # 8-390364

Confidential Business Information

Location Phone #: 5859244569

Location PBS #: 8-390364

Tank #	Grade	Capacity	Install Date
005	Regular	19782	9/12/2012

Annual Gasoline Throughput



Pressure Decay Test

Stage 1 Type	Last Fuel Delivery	Is a swivel/rotatable or locking clamp style equipment installed on all gasoline fill ports?	Is a swivel/rotatable or locking clamp style equipment installed on all gasoline Stage 1 Vapor Adapters?
☐ Co-Axial ☑ Dual Point ☐ Combination Are tanks manifolded in the vapor space? ☐ Yes ☑ No	Date & Time [1] 06/10/2026 11:00am	☑ Yes ☐ No	☑ Yes ☐ No

Pressure Decay Test Results

Tank Number	006A				Total
1. Product Grade	Premium				
2. Distance of Drop Tube from Tank Bottom (*inches*)	4				
3. Actual Tank Capacity *(gallons)*	7901				
4. Gasoline Volume *(gallons)*	2050				
5. Ullage [2] *(gallons)* (Ullage = Line #4 – Lines #5)	5851				
Start Time of Test	06/16/2026 12:10pm				
6. Initial Pressure *(inches H_2O)*	2.00				
7. Pressure After 1 Minute *(inches H_2O)*	2				
8. Pressure After 2 Minutes *(inches H_2O)*	2				
9. Pressure After 3 Minutes *(inches H_2O)*	2				
10. Pressure After 4 Minutes *(inches H_2O)*	2				
11. Pressure After 5 Minutes *(inches H_2O)*	2				
12. Allowable Pressure [3] *(inches H_2O)*	1.8359				
Result	☑ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	

Comments

UST Registration # 8-390364

Confidential Business Information

Location Phone #: 5859244569

Location PBS #: 8-390364

Tank #	Grade	Capacity	Install Date
006A	Premium	7901	9/12/2012

Annual Gasoline Throughput

Regular: 500,088
Plus: 22,829
Premium: 29,791
Diesel: 29,016

MECHANICAL AND ELECTRONIC LINE LEAK DETECTORS
PERFORMANCE TESTS

Facility Name: 7-Eleven			Owner: 7-Eleven Stores, Inc			
Address: 1283 Route 332			Address:			
City, State, Zip Code: Farmington NY 14425			City, State, Zip Code:			
Facility I.D. #: 8-390364			Phone #: 5859244569			
Testing Company: Owl Services USA			Phone #: 800-646-3161		Date: 6/16/2026	
This data sheet can be used to test mechanical line leak detectors (MLLD) and electronic line leak detectors (ELLD) with submersible turbine pump (STP) systems. See PEI/RP1200 Sections 9.1 and 9.2 for test procedures.						
Line Number	005	006A	006B			
Product Stored	Regular	Premium	Diesel			
Leak Detector Manufacturer	Vaporless	Vaporless	Red Jack et			
Leak Detector Model	99LD-2200	99LD-2200	FX1DV			
Type of Leak Detector	☑ MLLD ☐ ELLD	☑ MLLD ☐ ELLD	☑ MLLD ☐ ELLD	☐ MLLD ☐ ELLD	☐ MLLD ☐ ELLD	☐ MLLD ☐ ELLD
MLLD (ALL PRESSURE MEASUREMENTS ARE MADE IN PSIG)						
STP Full Operating Pressure	29	28	32			
Check Valve Holding Pressure	29	28	32			
Line Resiliency (ml) (line bleed back volume as measured from check valve holding pressure to 0 psig)	208.2	246.05	283.91			
Step Through Time in Seconds (time the MLLD hesitates at metering pressure before going to full operating pressure as measured from 0 psig with no leak induced on the line)	3	5	3			
Metering Pressure (STP pressure when simulated leak rate 3 gph at 10 psig)	16	15	10			
Opening Time in Seconds (the time the MLLD opens to allow full pressure after simulated leak is stopped)	3	5	3			
Does the STP pressure remain at or below the metering pressure for at least 60 seconds when the simulated leak is induced?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Does the leak detector reset (trip) when the line pressure is bled off to zero psig?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Does the STP properly cycle on/off under normal fuel system operation conditions?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
A "No" answer to either of the above questions indicates the MLLD fails the test.						
ELLD (ALL PRESSURE MEASUREMENTS ARE MADE IN PSIG)						
STP Full Operating Pressure						
How many test cycles are observed before alarm/shutdown occurs?						
Does the simulated leak cause an alarm?	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
A "No" answer to the above question indicates the ELLD fails the test.						
Does the simulated leak cause an STP shutdown?	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA	☐ Yes ☐ No ☐ NA
Test Results	☒ Pass ☐ Fail	☒ Pass ☐ Fail	☒ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail

Comments: Testing was conducted in accordance with PEI/RP1200

Tester Signature: Thomas Grinder

Tester Name: Thomas Grinder

UST OVERFILL EQUIPMENT INSPECTION
AUTOMATIC SHUTOFF DEVICE

Facility Name: 7-Eleven		Owner: 7-Eleven Stores, Inc	
Address: 1283 Route 332		Address:	
City, State, Zip Code: Farmington NY 14425		City, State, Zip Code:	
Facility I.D. #: 8-390364		Phone #:	
Testing Company: Owl Services USA		Phone #: 800-646-3161	Date: 6/16/2026

This data sheet is for inspecting automatic shutoff devices. See PEI/RP1200 Section 7 for inspection procedures.

Product Grade	Regular	Premium	Diesel			
Tank Number	005	006A	006B			
Tank Volume, gallons	19782	7901	11904			
Tank Diameter, inches	119	120	120			
Overfill Prevention Device Brand	OPW	OPW	OPW			
AUTOMATIC SHUTOFF DEVICE INSPECTION						
1. Drop tube removed from tank? If No, test fails, no need to answer questions 2-5.	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
2. Drop tube and float mechanisms free of debris?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
3. Float moves freely without binding and poppet moves into flow path?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
4. Bypass valve in the drop tube open and free of blockage (if present)?	☐ Yes ☐ No ☑ Not Present	☐ Yes ☐ No ☑ Not Present	☐ Yes ☐ No ☑ Not Present	☐ Yes ☐ No ☐ Not Present	☐ Yes ☐ No ☐ Not Present	☐ Yes ☐ No ☐ Not Present
5. Flapper adjusted to shut off flow at 95% capacity?*	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
A "No" to any item in Lines 2-5 indicates a test failure.						
Test Results	☒ Pass ☐ Fail	☒ Pass ☐ Fail	☒ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail

Comments:

*Use manufacturer's suggested procedure for determining if automatic shutoff device will shut off flow at 95% capacity.

Tester's Name (print) Thomas Grinder Tester's Signature 

Testing was conducted in accordance with PEI/RP1200

Form 1

Pressure/Vacuum (P/V) Vent Valve Data Sheet

Facility Name: 7-Eleven 35080	Test Date: 6/16/2026
Address: 1283 Route 332	Test Company: Owl Services USA
City : Farmington NY 14425	Tester Name: Thomas Grinder

P/V Valve Manufacturer: OPW	Model Number: 623V	Pass ✓	Fail
Manufacturers Specified Positive Leak Rate (CFH): + .05	**Manufacturers Specified Negative Leak Rate (CFH):** -.21		
Measured Positive Leak Rate (CFH): .04	Measured Negative Leak Rate (CFH): -.13		
Positive Cracking Pressure (in. H_2O): 4.75	Negative Cracking Pressure (in. H_2O): -8.25		

P/V Valve Manufacturer: OPW	Model Number: 623V	Pass ✓	Fail
Manufacturers Specified Positive Leak Rate (CFH): + .05	**Manufacturers Specified Negative Leak Rate (CFH):** -.21		
Measured Positive Leak Rate (CFH): .04	Measured Negative Leak Rate (CFH): -.15		
Positive Cracking Pressure (in. H_2O): 5.50	Negative Cracking Pressure (in. H_2O): -8.75		

P/V Valve Manufacturer:	Model Number:	Pass	Fail
Manufacturers Specified Positive Leak Rate (CFH):	**Manufacturers Specified Negative Leak Rate (CFH):**		
Measured Positive Leak Rate (CFH):	Measured Negative Leak Rate (CFH):		
Positive Cracking Pressure (in. H_2O):	Negative Cracking Pressure (in. H_2O):		

P/V Valve Manufacturer:	Model Number:	Pass	Fail
Manufacturers Specified Positive Leak Rate (CFH):	**Manufacturers Specified Negative Leak Rate (CFH):**		
Measured Positive Leak Rate (CFH):	Measured Negative Leak Rate (CFH):		
Positive Cracking Pressure (in. H_2O):	Negative Cracking Pressure (in. H_2O):		

Confidential Business Information

Location Phone #: 5859244569

Location PBS #: 8-390364

Tank #	Grade	Capacity	Install Date
005	Regular	19782	9/12/2012
006A	Premium	7901	9/12/2012

Annual Gasoline Throughput

Regular: 500,088
Plus: 22,829
Premium: 29,791
Diesel: 29,016

7-Eleven
1283 Route 332
Farmington
NY 14425

Purpora Engineering
Petro-Tite Line Tightness Test Form

Work Visit # 187802
UST Registration # 8-390364

IDENTIFY EACH LINE AS TESTED	TIME (MILITARY)	LOG OF TEST PROCEDURES, AMBIENT TEMPERATURE, WEATHER, ETC.	PRESSURE PSI BEFORE	PRESSURE PSI AFTER	VOLUME READING BEFORE	VOLUME READING AFTER	VOLUME NET CHANGE	REMARKS SIZE, LENGTH & TYPE OF LINE, #FLEX CONNECTORS, CONCLUSIONS
005	10:28	Connected line tester to: Shear						
Regular	10:30	Started line test		60		.010		
	10:40	Line Test Continued	60	60	.010	.010	0	
	10:50	Line Test Continued	60	60	.010	.010	0	
	11:00	Line Test Continued	60	60	.010	.010	0	
	11:00	Bleed Back	60	0	.010	.2	0.19	

Material OPW PC-20 (dark

Wall Type Double

Line Length (feet) 200

Diameter (inches) 1.5

Pressure/Suction Pressure

Allowable Bleedback

(PL x Ba) + (FC x Bb(.006)) + B(.05) = N

(200 * 0.00136)
+ (4 * 0.006) + 0.05 = 0.346

Tests were made on the above line systems in accordance with test procedures prescribed for as detailed on attached test charts with the results as follows:

Line Identification	Meets Criteria (Yes/No)	Net Volume Change Per Hour	Date Tested
005 Regular	Yes	0	6/16/2026

CONTRACTOR CERTIFICATION

Technician:
Thomas Grinder

f5b88a3d
Certification # _____

Notes:

7-Eleven
1283 Route 332
Farmington
NY 14425

Purpora Engineering
Petro-Tite Line Tightness Test Form

Work Visit # 187802
UST Registration #
8-390364

IDENTIFY EACH LINE AS TESTED	TIME (MILITARY)	LOG OF TEST PROCEDURES, AMBIENT TEMPERATURE, WEATHER, ETC.	PRESSURE PSI BEFORE	PRESSURE PSI AFTER	VOLUME READING BEFORE	VOLUME READING AFTER	VOLUME NET CHANGE	REMARKS SIZE, LENGTH & TYPE OF LINE, #FLEX CONNECTORS, CONCLUSIONS
006A	10:33	Connected line tester to: Shear						
Premium	10:35	Started line test		60		.020		
	10:45	Line Test Continued	60	60	.020	.020	0	
	10:55	Line Test Continued	60	60	.020	.020	0	
	11:05	Line Test Continued	60	60	.020	.020	0	
	11:05	Bleed Back	60	0	.020	.2	0.18	

Material OPW PC-20 (dark

Wall Type Double

Line Length (feet) 180

Diameter (inches) 1.5

Pressure/Suction Pressure

Allowable Bleedback

(PL x Ba) + (FC x Bb(.006)) + B(.05) = N

(180 * 0.00136)
+ (4 * 0.006) + 0.05 = 0.3188

Tests were made on the above line systems in accordance with test procedures prescribed for as detailed on attached test charts with the results as follows:

Line Identification	Meets Criteria (Yes/No)	Net Volume Change Per Hour	Date Tested
006A Premium	Yes	0	6/16/2026

CONTRACTOR CERTIFICATION

Technician:
Thomas Grinder

f5b88a3d
Certification # _____

Notes:

7-Eleven
1283 Route 332
Farmington
NY 14425

Purpora Engineering
Petro-Tite Line Tightness Test Form

Work Visit # 187802
UST Registration # 8-390364

IDENTIFY EACH LINE AS TESTED	TIME (MILITARY)	LOG OF TEST PROCEDURES, AMBIENT TEMPERATURE, WEATHER, ETC.	PRESSURE PSI BEFORE	PRESSURE PSI AFTER	VOLUME READING BEFORE	VOLUME READING AFTER	VOLUME NET CHANGE	REMARKS SIZE, LENGTH & TYPE OF LINE, #FLEX CONNECTORS, CONCLUSIONS
006B Diesel	10:38	Connected line tester to: Shear						
	10:40	Started line test		60		.080		
	10:50	Line Test Continued	60	60	.080	.080	0	
	11:00	Line Test Continued	60	60	.080	.080	0	
	11:10	Line Test Continued	60	60	.080	.080	0	
	11:10	Bleed Back	60	0	.080	.2	0.12	

Material OPW PC-20 (dark

Wall Type Double

Line Length (feet) 170

Diameter (inches) 1.5

Pressure/Suction Pressure

Allowable Bleedback

(PL x Ba) + (FC x Bb(.006)) + B(.05) = N

(170 * 0.00136) + (2 * 0.006) + 0.05 = 0.2932

Tests were made on the above line systems in accordance with test procedures prescribed for as detailed on attached test charts with the results as follows:

Line Identification	Meets Criteria (Yes/No)	Net Volume Change Per Hour	Date Tested
006B Diesel	Yes	0	6/16/2026

CONTRACTOR CERTIFICATION

Technician:
Thomas Grinder

f5b88a3d

Certification # _____

Notes:

SHEAR VALVE OPERATION INSPECTION

Facility Name: 7-Eleven	Owner 7-Eleven Stores, Inc
Address: 1283 Route 332	Address
City, State, Zip Code: Farmington NY 14425	City, State, Zip Code:
Facility I.D. #: 8-390364	Phone #: 5859244569
Testing Company: Owl Services USA	Phone #: 610-278-7203

This data sheet is for inspecting shear valves located inside dispensers. See PEI/RP1200 Section 10 for the inspection procedure.

Product Grade	Diesel	Premium	Regular	Premium	Regular	Diesel	Premium	Regular	
Dispenser ID#	1/2	1/2	1/2	3/4	3/4	5/6	5/6	5/6	
Shear ValveType (Product/Vapor)	Product	Product	Product	Product	Product	Product	Product	Product	
1. Is the shear valve rigidly anchored to the dispenser box frame or dispenser island?	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☐Yes ☐No
2. Is the shear section positioned between ½ inch above or below the top surface of the dispenser island?	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☐Yes ☐No
3. Is the lever arm free to move?	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☐Yes ☐No ☐NA
4. Does the lever arm snap shut the poppet valve?	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☑Yes ☐No ☐NA	☐Yes ☐No ☐NA
5. Can any product be dispensed when the product shear valve is closed?	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☑No ☐NA	☐Yes ☐No ☐NA
A "No" to Lines 1-4 or a "Yes" for Line 5 indicates a test failure.									
Test Results	☑Pass ☐Fail	☑Pass ☐Fail	☑Pass ☐Fail	☑Pass ☐Fail	☑Pass ☐Fail	☑Pass ☐Fail	☑Pass ☐Fail	☑Pass ☐Fail	☐Pass ☐Fail

Comments:

Tester's Name (print) Thomas Grinder Tester's Signature _____ 6/16/2026

Testing was conducted in accordance with PEI/RP1200

AUTOMATIC TANK GAUGE OPERATION INSPECTION


Facility Name: 7-Eleven		Owner: 7-Eleven Stores, Inc	
Address: 1283 Route 332		Address:	
City, State, Zip Code: Farmington NY 14425		City, State, Zip Code:	
Facility I.D. #: 8-390364		Phone #: 5859244569	
Testing Company: Owl Services USA		Phone #: 800-646-3161	Date: 6/16/2026

This procedure is to determine whether the automatic tank gauge (ATG) is operating properly. See PEI/RP1200 Section 8.2 for the inspection procedure. This procedure is applicable to tank level monitor probes that touch the bottom of the tank when in place.

Tank Number	005	006A	006B	
Product Stored	Regular	Premium	Diesel	
ATG Brand and Model	Veeder Root TLS-350	Veeder Root TLS-350	Veeder Root TLS-350	
1. Tank Volume, gallons	19782	7901	11904	
2. Tank Diameter, inches	119	120	120	
3. The ATG probe was removed from the tank and inspected for damage and residual buildup.	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No
4. Float moves freely on the stem without binding?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No
5. Fuel float level agrees with the value programmed into the console?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No
6. Water float level agrees with the value programmed into the console?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No
7. Inch level from bottom of probe when 90% alarm is triggered.	102	102	102	
8. Inch level at which the overfill alarm activates corresponds with value programmed in the gauge?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No
9. Inch level from the bottom when the water float first triggers an alarm.	1	1	1	
10. Inch level at which the water float alarm activates corresponds with value programmed in the gauge?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No
If any answers in Lines 3, 4, 5, or 6 are "No," the system has failed the test.				
If internal ATG battery backup is present, was it functional per manufacturer's specifications. ☑ Yes ☐ No ☐ None				
Test Results	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☐ Pass ☐ Fail

Comments:

Tester's Name (print) Thomas Grinder Tester's Signature



LIQUID SENSOR FUNCTIONALITY TESTING

Facility Name: 7-Eleven				Owner: 7-Eleven Stores, Inc			
Address: 1283 Route 332				Address:			
City, State, Zip Code: Farmington NY 14425				City, State, Zip Code:			
Facility I.D. #: 8-390364				Phone #: 5859244569			
Testing Company: Owl Services USA				Phone #: 800-646-3161		Date: 6/16/2026	

This procedure is to determine whether liquid sensors located in the interstitial space of UST systems are able to detect the presence of water and fuel. See PEI/RP1200 Section 8.3 for the test procedure.

Sensor Location	005 STP Sump	006A STP Sump	006B STP Sump				
Product Stored	Regular	Premium	Diesel				
Type of Sensor	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating
Test Liquid	☑ Water ☐ Product	☑ Water ☐ Product	☑ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product
Is the ATG console clear of any active alarms regarding any leak sensors? If the sensor is in alarm and functioning, indicate why.	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Is the sensor alarm circuit operational?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Has sensor been inspected and in good operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When placed in the test liquid, does the sensor trigger an alarm?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When an alarm is triggered, is the sensor properly identified on the ATG console?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Any "No" answers indicates a test failure.							
Test Results	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail

Comments:

Tester's Name (print) Thomas Grinder Tester's Signature Thomas Grinder

LIQUID SENSOR FUNCTIONALITY TESTING

Facility Name: 7-Eleven		Owner: 7-Eleven Stores, Inc	
Address: 1283 Route 332		Address:	
City, State, Zip Code: Farmington NY 14425		City, State, Zip Code:	
Facility I.D. #: 8-390364		Phone #: 5859244569	
Testing Company: Owl Services USA		Phone #: 800-646-3161	Date: 6/16/2026

This procedure is to determine whether liquid sensors located in the interstitial space of UST systems are able to detect the presence of water and fuel. See PEI/RP1200 Section 8.3 for the test procedure.

Sensor Location	005 Tank Interstitial	006A/006B Tank Interstitial					
Product Stored	Regular	Premium /					
Type of Sensor	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating
Test Liquid	☑ Water ☐ Product	☑ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product
Is the ATG console clear of any active alarms regarding any leak sensors? If the sensor is in alarm and functioning, indicate why.	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Is the sensor alarm circuit operational?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Has sensor been inspected and in good operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When placed in the test liquid, does the sensor trigger an alarm?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When an alarm is triggered, is the sensor properly identified on the ATG console?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Any "No" answers indicates a test failure.							
Test Results	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail

Comments:

Tester's Name (print) Thomas Grinder Tester's Signature 

LIQUID SENSOR FUNCTIONALITY TESTING

Facility Name: 7-Eleven		Owner: 7-Eleven Stores, Inc	
Address: 1283 Route 332		Address:	
City, State, Zip Code: Farmington NY 14425		City, State, Zip Code:	
Facility I.D. #: 8-390364		Phone #: 5859244569	
Testing Company: Owl Services USA		Phone #: 800-646-3161	Date: 6/16/2026

This procedure is to determine whether liquid sensors located in the interstitial space of UST systems are able to detect the presence of water and fuel. See PEI/RP1200 Section 8.3 for the test procedure.

Sensor Location	Dispenser 1/2	Dispenser 3/4	Dispenser 5/6				
Product Stored	Regular, Plus, Super Premium, Diesel	Regular, Plus, Super Premium	Regular, Plus, Super Premium, Diesel				
Type of Sensor	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☑ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating	☐ Discriminating ☐ Non-discriminating
Test Liquid	☑ Water ☐ Product	☑ Water ☐ Product	☑ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product	☐ Water ☐ Product
Is the ATG console clear of any active alarms regarding any leak sensors? If the sensor is in alarm and functioning, indicate why.	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Is the sensor alarm circuit operational?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Has sensor been inspected and in good operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When placed in the test liquid, does the sensor trigger an alarm?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
When an alarm is triggered, is the sensor properly identified on the ATG console?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
Any "No" answers indicates a test failure.							
Test Results	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☑ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail	☐ Pass ☐ Fail

Comments:


Tester's Name (print) Thomas Grinder Tester's Signature Thomas Grinder


Crompco LLC
1815 Gallagher Rd
Plymouth Meeting, PA 19462

7-Eleven Stores, Inc
Location #35080

1283 Route 332
Farmington, NY 14425
+1 585-924-4569

Diagram - Site Diagram (v2)

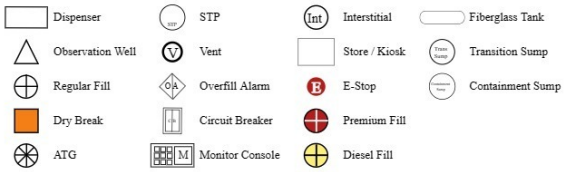

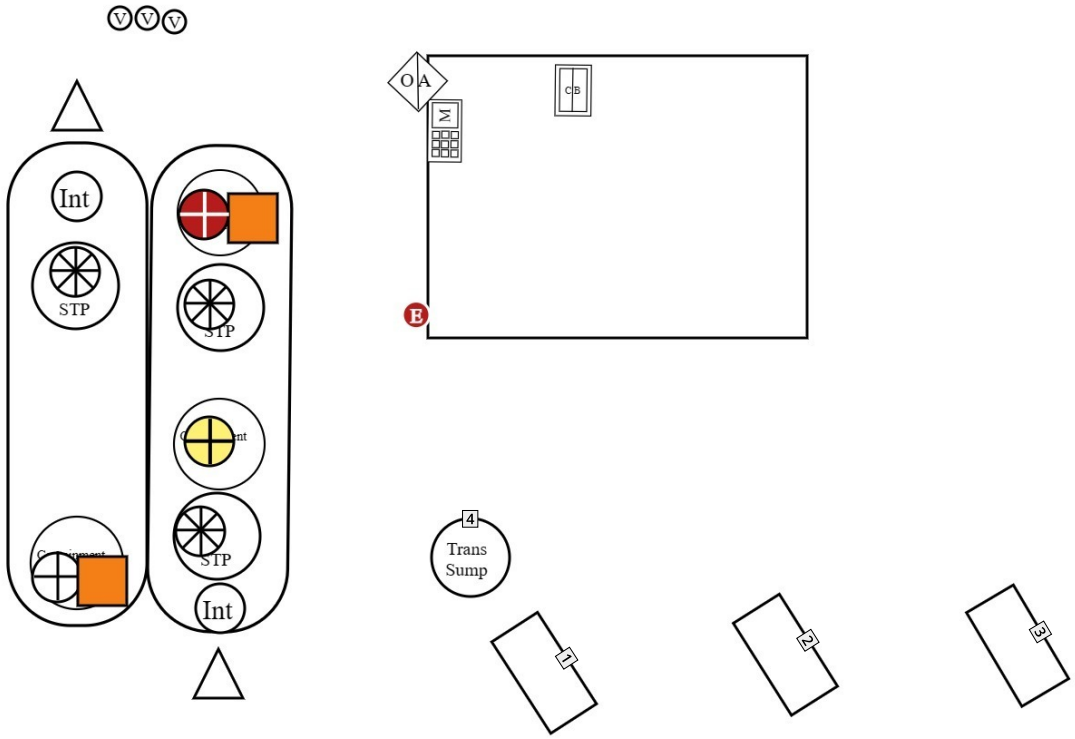

1: Dispenser - 5/6 w/ diesel
2: Dispenser - 3/4
3: Dispenser - 1/2 w/ diesel
4: Transition Sump - w/ sensor

Visit Verification

CUSTOMER
7-Eleven Stores, Inc

LOCATION
#35080
1283 Route 332
Farmington, NY 14425

CONTACT
7-Eleven Stores, Inc

SCHEDULED
06/16/2026 12:00am (EDT)

ASSIGNED TO
Tyzay McClinton, Thomas Grinder

SERVICE REASON
Compliance

PRODUCTS & SERVICES

Item	Qty
Combos	
All Lines and Leak Detectors	3.00
Federal Stage I Pressure Decay, Pressure Relief Valve	1.00
Expenses	
Fuel Surcharge	1.00
Products	
Cap Monitor Cable Grip 3/8 in [375]	1.00
Services	
Monitor System Inspection Automatic Tank Gauging System / Monitor System Inspection	1.00
All Shear Valves	3.00
Emergency Stop Inspection	1.00
Overfill Verification	1.00
Additional Pressure Decay Test	1.00

CONFIRMATION
By signing this verification you are agreeing that we have performed and/or provided services and parts listed above.

Approver's Name
Charlene Worley

Email

Signature Status
Nobody available to sign