PHASE I ENVIRONMENTAL SITE ASSESSMENT

for

East Adams Redevelopment Phase Three Area
200 Chavez Terrace
Syracuse, New York

Prepared for:

McCormack Baron Salazar, Inc. (MBSDI)
100 North Broadway, Suite 100
St. Louis, Missouri 63102

Prepared by:

Langan Engineering, Environmental, Surveying,
Landscape Architecture and Geology, D.P.C.
368 Ninth Avenue, 8th Floor
New York, New York 10001

Kimberly Semon, PE
Senior Project Manager

Brian Gochenaur, QEP
Associate Principal/Vice President

Report Date: **24 January 2025**
180-Day Viability Date: **5 April 2025**
170859701

LANGAN

TABLE OF CONTENTS

EXECUTIVE SUMMARY **i**

1. Introduction **1**

1.1 PURPOSE 1

1.2 SCOPE OF SERVICES 1

1.3 USER RESPONSIBILITIES 3

1.4 LIMITING CONDITIONS/DEVIATIONS 3

1.5 DATA GAPS 4

2. Subject Property Description and Current Use **5**

2.1 LOCATION, LEGAL DESCRIPTION, AND OWNERSHIP 5

2.2 PHYSICAL SETTING 5

2.3 SUBJECT PROPERTY DESCRIPTION 6

2.4 CURRENT SUBJECT PROPERTY USE 6

2.5 HAZARDOUS SUBSTANCES AND PETROLEUM PRODUCTS 7

2.6 AIR EMISSIONS 7

2.7 WASTE MANAGEMENT 8

2.8 WASTEWATER 8

2.9 STORM WATER 8

3. Subject Property History and Records Review **9**

3.1 HISTORICAL SUMMARY 9

3.2 REGULATORY DATABASE REVIEW 9

3.3 PRIOR REPORT REVIEW 10

4. Adjoining Properties and Surrounding Area **11**

4.1 CURRENT USE OF ADJOINING PROPERTIES AND SURROUNDING AREA 11

4.2 ADJOINING PROPERTIES AND SURROUNDING AREA HISTORY 11

4.3 REGULATORY DATABASE REVIEW 12

5. Findings, Opinions and Conclusions **16**

6. Environmental Professional Statement **18**

7. References **19**

8. Limitations and Definitions **21**

8.1 ASTM DEFINITIONS 21

8.2 STANDARD ENVIRONMENTAL RECORD SOURCES 24

TABLES

Table ES-1 Conclusions, Findings and Opinions

Table 2-1 Utility Providers

Table 3-1 Subject Property History

Table 4-1 Current Use of Adjoining Properties and Surrounding Area

Table 4-2 Historical Use of Adjoining Properties

Table 5-1 Conclusions, Findings and Opinions

Table 7-1 Dates of Assessment Components

APPENDICES

Appendix A Figures

- Figure 1 Subject Property Location Map
- Figure 2 Subject Property Layout
- Figure 3 Nearby Properties Map

Appendix B Agency Records and Other Reports

Appendix C Site Reconnaissance Checklist and Photographs

Appendix D User Provided Information

Appendix E Historical Resources

Appendix F Environmental Database Report

Appendix G Resumes of Environmental Professionals

EXECUTIVE SUMMARY

Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C. (Langan) completed a Phase I Environmental Site Assessment (ESA) of the East Adams Redevelopment Phase Three Area located at 200 Chavez Terrace in Syracuse, New York (the "subject property") under the written authorization of McCormack Baron Salazar, Inc. (MBSDI) (the "Client" and the "user").

The Phase I ESA was completed following the guidelines of ASTM International Standard Practice E1527-21 (ASTM E1527-21), the United States Environmental Protection Agency's (US EPA) All Appropriate Inquiries (AAI) Rule, and industry standard practice. The user requested this ESA as part of their environmental due diligence related to a potential transaction involving the subject property.

Subject Property Layout

The about 3.1-acre subject property is identified as part of Onondaga County Tax Parcel ID Section 095, Block 08, Lot 01.0. The subject property is bound by multi-family residential housing to the north, South Townsend Street to the east, multi-family residential housing to the south, and South State Street to the west. The subject property is improved with six two-story residential townhouse apartments consisting of two six-unit apartment buildings, two four-unit apartment buildings, one three-unit apartment building, and one two-unit apartment building. The remainder of the subject property comprises asphalt-paved parking lots, landscaped areas and concrete-paved sidewalks. The main entrance is located on South State Street, along the western side of the subject property.

Subject Property Current Use

The subject property operates as a multi-family townhouse apartment complex with 25 residential units, known as Chavez Terrace.

Subject Property History

The subject property has historically been used for various residential and commercial purposes including the "Syracuse Twist Drill Co." which consisted of a machine shop, polish shop, coal bins, iron storage, oil shed, and petroleum bulk storage (1892 to 1971), brick and glass forge shop (1910 to 1971), used car sales lot (1939 to 1959), an auto yard (1951 to 1961), and a junk house (1951 to 1961). The subject property was redeveloped for residential use in 1978 and redeveloped into its present-day residential multi-family building configuration by 1990.

Adjoining Properties and Surrounding Area

The adjoining and surrounding area was developed with mostly residential and mixed residential and commercial buildings by the late 1800s. Between the 1900s and 1970s, the area became increasingly developed with multi-story residential, institutional, and commercial buildings.

Conclusions

Langan completed a Phase I ESA of the subject property using the scope guidelines and inherent limitations of ASTM E1527-21. Table ES-1 presents the conclusions of the Phase I ESA.

Table ES-1 Findings, Opinions, and Conclusions

ASTM E1527-21 Scope Items
Recognized Environmental Conditions (RECs)
Historical Use of the Subject Property: Historical uses of the subject property include a drilling company with a machine shop, forge shop, milling facility, coal bins, a transformer house, underground storage tanks (USTs), and an oil house; used car sales; an auto yard; manufacturing and warehousing facilities; an auto repair shop; and a junk house from at least 1892 until 1971. Historical operations of the subject property are considered a REC, as inadvertent releases of petroleum products, chemicals, or other hazardous substances resulting from historical operations may have affected soil, groundwater, and/or soil vapor at the subject property.
Historical Use and Documented Contamination at the Southern Adjoining Property: Historical operations on the south-adjoining property included an electric motor bottling facility in the 1910s, a gasoline station in the 1950s, a drycleaner in the 1950s and early 1960s, and a junk yard from the 1910s through the 1960s. The property was listed in the NY Spills database under New York State Department of Environmental Conservation (NYSDEC) Spill No. 2400040, which was reported on 2 April 2024 after soil and groundwater impacted with benzene, toluene, ethylbenzene, and xylenes (BTEX) were identified during a subsurface investigation. Cleanup is pending, and the spill remains open. The historical use and documented impacts at the south-adjoining property may have impacted soil, groundwater, and/or soil vapor at the subject property and this adjoining property is considered a REC.
Controlled Recognized Environmental Conditions (CRECs)
Langan did not identify CRECs.
Historical Recognized Environmental Conditions (HRECs)
Langan did not identify HRECs.
De Minimis Conditions
Langan did not identify de minimis conditions.
Significant Data Gaps
Langan did not identify significant data gaps.
Non-ASTM E1527-21 Scope Items
Business Environmental Risks (BERs)
Non-Native Fill: According to the United States Department of Agriculture (USDA) data for Onondaga County, the subject property is likely underlain by a layer of non-native fill. Non-native fill found in urban environments typically contains ash, demolition debris, and/or municipal waste products and may contain contaminants (e.g., semi-volatile organic compounds [SVOCs] or metals) at concentrations above applicable regulatory standards. The occurrence of historic fill does not trigger any regulatory obligations or reporting requirements but may require remedial measures to prevent exposure to property occupants and may require implementation of soil handling and management procedures during site redevelopment to address excavation, re-use, handling, and off-site disposal. Appropriate soil handling and management procedures will be implemented during site redevelopment to address human exposure, excavation, re-use, handling, and off-site disposal.
Additional Findings
The northern adjoining property (East Adams Redevelopment - Phase I Area/ Syracuse Police Dept Gas Depot) located at 100 Angelou Terrace was identified in the NY Brownfields database under the name

ASTM E1527-21 Scope Items

'East Adams Redevelopment – Phase One Area' and NYSDEC BCP Site No. C734162. An environmental investigation conducted at the subject property in 2023 identified contaminants of concern including metals and perfluorooctanesulfonic acid (PFOS) in soil, total metals, perfluorooctanoic acid (PFOA) and PFOS groundwater, and volatile organic compounds (VOC) in soil vapor. A BCP application was subsequently prepared in an effort to received confirmation from NYSDEC that remediation was not required for the site. Based on the denial letter from NYSDEC, the site does not require remediation and therefore is not considered a REC .

The southeastern adjoining property (Syracuse Housing Auth - Pioneer Homes/Parking Lot) located at 116-118 Radisson Court/Dablon Court was identified in the NY Spills, UST, Resource Conservation and Recovery Act (RCRA) Small Quantity Generator (SQG), and manifest databases. Based on the distance and cross-gradient location with respect to the subject property, closed status of the spill and tanks associated with the site, and absence of violations related to RCRA generation at the site, it is unlikely that potential releases at the site would have impacted the subject property; and is therefore not considered a REC.

The property (East Adams Redevelopment – Phase II Area/Salvation Army/Spill Number 9601904) is located at 1105-1117 South State Street and was identified in the NY Brownfields database as East Adams Redevelopment – Phase Two Area and NYSDEC BCP Site No. C734163. Contamination identified at the site during previous environmental investigations included VOCs, SVOCs and metals in soil; VOCs, SVOCs, and total metals in groundwater; and petroleum-related VOCs in soil vapor. The site will be remediated in accordance with a NYSDEC-approved RAWP. Based on the distance and cross-gradient location, it is unlikely that potential releases or contamination would have impacted the subject property; and is therefore not considered a REC.

The listing (Manhole 7-1) located at 907 South Townsend Street was identified in the NY Spills database as an open spill that was called in when a sheen was observed in a manhole by National Grid. Based on the listing information, Clean Harbors, an environmental remediation company, was called to the scene to clean the spill and no further action is needed. Based on the distance and cross-gradient location, it is unlikely that potential releases or contamination would have impacted the subject property; and is therefore not considered a REC.

The property (Steam Heat Syr University/Steam Station/Syracuse University – Steam Station/Steam Station/SU Chilled Water Plant) located at 500 East Taylor Street was identified in the Leaking Tanks (LTANKS), UST, Aboveground Storage Tank (AST), Chemical Bulk Storage (CBS) AST, NY Spills, RCRA NonGen, E-Manifest, NY Manifest and New Jersey (NJ) Manifest databases. Based on the distance and cross-gradient location with respect to the subject property, closed status of the spill and tanks associated with the site, and absence of violations related to RCRA generation at the site, it is unlikely that potential releases at the site would have impacted the subject property; and is therefore not considered a REC.

The RECs and BER described above will be further investigated during a Phase II Environmental Site Investigation (ESI).

1. INTRODUCTION

Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C. (Langan) completed a Phase I Environmental Site Assessment (ESA) of the East Adams Redevelopment Phase Three Area property located at 200 Chavez Terrace in Syracuse, New York (the "subject property") under the written authorization of McCormack Baron Salazar, Inc. (MBSDI) (the "Client" and the "user"). A Subject Property Location Map is provided in Appendix A (Figure 1).

The Phase I ESA was completed following the guidelines of ASTM International Standard Practice E1527-21 (ASTM E1527-21), the United States Environmental Protection Agency's (US EPA) All Appropriate Inquiries (AAI) Rule, and industry standard practice. The user requested this ESA as part of their environmental due diligence associated with a potential transaction involving the subject property.

1.1 Purpose

The purpose of this Phase I ESA is to identify recognized environmental conditions (REC) associated with the subject property. This purpose also includes identifying controlled recognized environmental conditions (CREC), historical recognized environmental conditions (HREC), de minimis conditions, and significant data gaps. The definitions of REC, CREC, HREC, de minimis condition and other select ASTM terms used in this report are in Section 8.

1.2 Scope of Services

Langan's scope of services consisted of the completion of a Phase I ESA following the guidelines of ASTM E1527-21. Langan's scope of services as it pertains to the elements of a Phase I ESA as specified in ASTM E1527-21 is described below.

On 8 July 2024, the US EPA final rule designating two per- and polyfluoroalkyl substances (PFAS) – perfluorooctanoic acid (PFOA) and perfluorooctanesulfonic acid (PFOS) including their salts and structural isomers – as hazardous substances under the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) became effective. Because of the complex and varied historical use of PFAS in various industries; limited prior disclosures of PFAS content on product specification sheets, Material Safety Data Sheets (MSDS), and Safety Data Sheets (SDS); the complex chemistry and chemical transformations associated with some PFAS; and the ever-growing and varied list of state regulations, it is not feasible to evaluate PFOA and PFOS without also considering other PFAS. As such, absent analytical data, Langan incorporated a review of PFAS as a general class into this Phase I ESA.

PFAS and other CERCLA hazardous substances and petroleum products have been detected in background environmental samples across the globe, including in areas removed from specific recognized sources. This Phase I ESA was not intended to evaluate background concentrations of CERCLA hazardous substances or petroleum products, regardless of whether the source is naturally occurring or anthropogenic. The objective of Langan's scope of services was to identify the presence, likely presence, and/or material threat of a release of CERCLA hazardous substances and petroleum products related to specific property uses that are generally recognized as known or potential sources of such substances and products.

1.2.1 Records Review and Local Government Interviews

Langan contracted a third-party provider to search environmental regulatory databases and provide historical records. The database search included select federal, state, local and tribal standard source environmental databases within the approximate search radii specified by ASTM E1527-21.

Langan submitted Freedom of Information Act (FOIA) requests to supplement environmental database listing information. The FOIA requests were submitted to the Syracuse Office of the Corporation Counsel, Onondaga County Fire Investigations Department, New York State Department of Health (NYSDOH), New York State Department of Environmental Conservation (NYSDEC), United States Geological Survey (USGS) mapping, and US EPA databases. Agency FOIA-requested information, where received, is discussed in relevant sections of this report and referenced in Section 7. Pertinent documents are provided in Appendix B.

Langan supplemented the third-party-provided historical records with review of online historical record sources including Google Earth Pro and NETR Online.

1.2.2 Site Reconnaissance and Owner/Operator/Occupant Interviews

Langan completed the site reconnaissance on 3 September 2024. Nick Hodom of Langan was unaccompanied during the site reconnaissance.

Langan walked the periphery of the subject property, observed the subject property from adjoining public thoroughfares, and walked the accessible interiors of structures at the subject property. Langan observed the adjoining properties and the surrounding area from the periphery of the subject property and from public thoroughfares adjoining to or traveled on to access the subject property. The weather at the time of the site reconnaissance was approximately 70°F and sunny. Photographs from the site reconnaissance are provided in Appendix C.

Langan interviewed Melissa Liquori (the key site manager) of Syracuse Housing Authority (SHA) on 4 and 5 September 2024. An owner questionnaire was provided to SHA August 30, 2024. Reasonable attempts were made to obtain the completed owner questionnaire. Should responses be received that would alter the findings of this Phase I ESA, an addendum will be issued.

1.2.3 Evaluation, Report and Parts Used in Concert

Langan evaluated the information obtained from the records reviews, site reconnaissance and interviews described above, and from the user as described in Section 1.3 in concert with each other. Langan's findings, opinions, and conclusions are discussed throughout this report. Significant assumptions, or deletions, deviations or exceptions to ASTM E1527-21 are noted in Section 1.4.

1.2.4 Non-ASTM Scope Services

The scope of services for the Phase I ESA did not include non-scope ASTM considerations.

1.2.5 Vapor Encroachment Screening

Langan completed a limited vapor encroachment screening for potential vapor encroachment conditions (VEC), in general conformance with ASTM E2600-15 Standard Guide for Vapor Encroachment Screening, which may affect the subject property. The VEC screening focused on

the current and historical use of the subject property and utilized the regulatory agency database report provided by Environmental Data Resources, Inc. (EDR) to evaluate identified chemicals of concern (ChOC). To identify the area of concern (AOC) for contaminated sites with non-petroleum hydrocarbon ChOCs, Langan utilized the approximate minimum search distance defined by ASTM E2600-15 of 1,760 feet (1/3 mile) from the subject property boundary for ChOC-contaminated sites. For sites contaminated with petroleum hydrocarbon ChOCs, Langan utilized the AOC approximate minimum search distance of 528 feet (1/10 mile). The AOC was adjusted accordingly based on review of physical setting characteristics, known release information, subject property land features, groundwater flow direction and soil type, et al.

ASTM's Vapor Encroachment guidance indicates that when groundwater flow direction can be estimated or determined, the cross-gradient or down-gradient radius distances can be significantly reduced. The reduced AOC distances were calculated when considering groundwater flow direction by utilizing the following default distances, which were determined using the Buonicore Methodology: (non-petroleum hydrocarbon ChOCs) 1,760 feet in the upgradient direction; 365 feet in the cross-gradient direction; and 100 feet in the downgradient direction and (petroleum hydrocarbon ChOCs) 528 feet in the upgradient direction; 165 feet in the cross-gradient direction if Light Non-Aqueous Phase Liquid (LNAPL, i.e., floating product) is suspected; 95 feet in the cross-gradient direction if no LNAPL is suspected; 100 feet in the downgradient direction (LNAPL suspected); and 30 feet in the downgradient direction (LNAPL not suspected).

VECs are further discussed in Sections 4.2 and 4.3.2.

1.3 User Responsibilities

Langan requested that the user provide the results of tasks the user is responsible for completing to satisfy the requirements of AAI. The tasks includes: provision of information related to specialized knowledge or experience of the user or the degree of obviousness relative to conditions indicative of releases or threatened releases; actual knowledge of the user regarding environmental liens or AULs related to the subject property; specialized knowledge or experience of the user; reasons for significantly lower purchase prices, and commonly known or reasonably ascertainable information within the local community about the subject property. Langan also requested that the user state the reason the Phase I ESA was requested. A summary of the user's responses is provided in Appendix D and relevant information provided by the user is discussed in applicable sections of this report.

Langan contracted EDR to conduct an environmental lien and AUL search for the subject property. The result of the search, which included a compilation of available data and verification of the findings with the appropriate regulatory authorities, did not reveal environmental liens or AULs. A copy of the environmental lien search is provided in Appendix E.

1.4 Limiting Conditions/Deviations

Langan was unable to access each residential unit of the subject property due to tenant occupation at the time of the site reconnaissance. Four units were accessed during the site reconnaissance. The key site manager confirmed that unit layouts and appliances were consistent throughout the building. The key site manager noted that no chemical use (apart from household cleaning products) or hazardous materials is expected within the residential units. Therefore, this limiting condition did not impact Langan's conclusions.

Langan did not delete or deviate from the ASTM E1527-21 guidelines during this Phase I ESA.

1.5 Data Gaps

Data gaps, if encountered, are discussed throughout the report. Significant data gaps, if any, are summarized in Section 5.0.

2. SUBJECT PROPERTY DESCRIPTION AND CURRENT USE

The following sections describe the subject property location, ownership, physical setting, and current layout and operations.

2.1 Location, Legal Description, and Ownership

The about 3.1-acre subject property is identified on the Onondaga County Tax Map as part of Section 095, Block 08, Lot 01.0. The subject property is bound by residential buildings and to the north, South Townsend Street followed by residential buildings to the east, residential buildings to the south, and South State Street followed by a public park to the west. The subject property is owned by the SHA.

A Subject Property Location Map is included as Figure 1 in Appendix A of this report. The current property records and deed information can be found in Appendix B of this report.

2.2 Physical Setting

The physical setting that includes the geologic, hydrogeologic, hydrologic, and topographic characteristics of the subject property and surrounding area is discussed below.

2.2.1 Topography

The 2019 United States Geological Survey (USGS) 7.5-minute quadrangle topographic map for Syracuse East depicts the subject property at an elevation of approximately 400 feet[1] above mean sea level (amsl) and is generally flat. The regional topography slopes downward toward the west and the Onondaga Creek, which is located approximately 2,000 feet west of the subject property.

2.2.2 Geology

According to the U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) Soil Survey Geographic (SSURGO) data for the subject property, soils at the subject property are comprised primarily of urban land. Urban land is described as excavated, filled, and made land. Typically, these soils have been mixed with other materials, such as brick, concrete, and demolition debris of unknown origin (non-native fill). Non-native fill found in urban environments typically contains ash, demolition debris, and/or municipal waste products and may contain contaminants (e.g., semi volatile organic compounds [SVOCs] or metals) at concentrations above current regulatory standards. Non-native fill does not trigger a regulatory reporting requirement but is a business environmental risk (BER) because it is often associated with cost premiums for handling, management, transport, and disposal.

Based on review of the USGS "Geologic Map of New York, Finger Lakes Sheet (Fisher, Isachsen, Rickard, dated March 1970)", the subject property is underlain by bedrock of the Syracuse Foundation, consisting of dolostone, shale, gypsum and salt.

[1] Elevations in this report refer to North American Vertical Datum of 1988 (NAVD88), which is about 1.1 feet above mean sea level at Sandy Hook, New Jersey.

2.2.3 Hydrogeology

Surface water bodies are not present within the boundary of the subject property. The nearest surface water body is the Onondaga Creek, located approximately 2,000-feet west of the subject property. Information regarding subject property-specific groundwater flow direction is unavailable. Groundwater flow can be influenced by several factors such as surface water bodies, wetlands, hydrogeologic and anthropogenic variables. However, based on topographic gradient and proximity to the Onondaga Creek, it is expected that groundwater generally flows to the west.

A review of the Geocheck section of the LightBox Environmental Data Resources (EDR) Regulatory Database Report (Appendix F) did not identify groundwater wells on the subject property. Two USGS test holes were identified 400 feet north of the subject property; however, groundwater data or boring logs were not available.

2.3 Subject Property Description

The about 3.1-acre subject property is improved with six two-story residential townhouse apartments identified as Chavez Terrace. The apartment complex consists of two six-unit apartment buildings, two four-unit apartment buildings, one three-unit apartment building, and one two-unit apartment building. The remainder of the subject property comprises asphalt-paved parking lots, landscaped areas and concrete-paved sidewalks. The main entrance is located on South State Street, along the western side of the subject property.

Each apartment has a front and rear exit and an interior stairway to the second floor. The main floor of each apartment consists of an entryway foyer, closets, a laundry room, a kitchen, and a living room. Bedrooms, bathrooms, and a utility room occupy the second floor of each apartment.

Each apartment is equipped with a natural-gas fired Bradford White 40-gallon hot water heater and a 75,000-British Thermal Units (BTU), natural-gas fired Utica boiler. Heating is supplied via the Utica boiler to various floorboard heaters located throughout the apartments. Electric powered window mounted air conditioners were observed throughout various tenant spaces. Six utility-owned electrical transformers are located throughout the exterior of the subject property.

According to the Rezone Syracuse ordinance and City of Syracuse Zoning Map, the subject property is located within an MX-2: Neighborhood Center District. The MX-2: Neighborhood Center zoning district is generally characterized as pedestrian-friendly, transit-supportive areas of medium density residential development and a well-integrated mix of non-residential uses. The surrounding properties are zoned for MX-2: Neighborhood Center Districts, LI: Light Industry and Employment Districts, and OS: Open Space Districts. A copy of the zoning map is included in Appendix B.

A Subject Property Layout Map is provided in Figure 2 of Appendix A. Photographs of the subject property and a checklist documenting Langan's observations relative to the features, activities, uses and conditions outlined in Section 9.4 of ASTM E1527-21 are in Appendix C.

2.4 Current Subject Property Use

The subject property operates as a multi-family building with 25 residential units.

The following table summarizes subject property utility providers.

Table 2-1 Utility Providers

Utility	Providers
Electricity	National Grid
Natural gas	National Grid
Water	City of Syracuse
Sewer	Onondaga County

2.5 Hazardous Substances and Petroleum Products

Langan did not observe hazardous substances at the subject property. Langan did not observe storage tanks, pits, ponds, lagoons, unidentified substance containers, or stressed vegetation at the subject property.

2.5.1 Underground Storage Tanks (UST)

Langan did not observe USTs or fill ports indicating the presence of a UST at the subject property. Information regarding historical USTs at the subject property is included in Section 3.2.

2.5.2 Aboveground Storage Tanks (AST)

Langan did not observe ASTs or fill ports indicating the presence of an AST at the subject property. Information regarding historical ASTs at the subject property is included in Section 3.2.

2.5.3 Drums, Totes, and Intermediate Bulk Containers

Langan did not observe drums, totes, or other intermediate bulk containers larger than the retail containers described below.

2.5.4 Other Chemical Storage, Containers, or Equipment

Langan observed shelves containing retail-size containers of janitorial products within kitchen cabinets throughout the ground floor of the apartment spaces. Containers included products such as bleach, glass cleaner, and multi-purpose cleaner. Additionally, empty gasoline containers were observed within exterior closet spaces near the main entrances of two apartment units. No staining, odors, or other evidence of a release was observed in the vicinity of the chemical storage areas.

Six utility-owned electrical transformers are located throughout the subject property. Due to the age of the buildings (circa 1990s), it is unlikely that transformers would contain PCBs. No staining, odors, or other evidence of a release was observed on or surrounding the transformers.

2.6 Air Emissions

Air emission sources at the subject property include boiler exhaust and dryer exhaust fan vents. Langan did not identify obvious impacts, such as visible emissions or odors, from air emission sources at the subject property.

Langan does not consider air emissions an environmental concern for the subject property.

2.7 Waste Management

The following sections describe current hazardous and non-hazardous waste streams, and observations of fill areas or other solid waste throughout the subject property.

2.7.1 Hazardous Waste

Langan did not observe any indication of hazardous waste generation at the subject property.

2.7.2 Non-Hazardous Waste

Non-hazardous waste generated at the subject property includes general refuse from building occupants. Bins containing general refuse were observed throughout the subject property. Generated refuse is deposited into two solid-waste dumpsters located within the asphalt-paved parking lot along Chavez Terrace for pick-up by a local disposal company as needed. Non-hazardous waste containers appeared to be intact without obvious indications of a release or material threat of a future release.

2.7.3 Fill Areas or Solid Waste

Langan did not observe areas that were apparently filled or graded by non-natural causes (or filled with material of unknown origin) that suggest the presence of garbage, construction debris, demolition debris, or other solid waste disposal, or mounds or depressions suggesting solid waste disposal. Information regarding non-native fill at the subject property is described in Section 2.2.2.

2.8 Wastewater

Sanitary wastewater is discharged to the city municipal sanitary sewer system. Floor drains were observed in the laundry room and utility rooms throughout the apartment buildings. No sheen, odors, or other evidence of a release were observed in the vicinity of the drains.

Langan did not observe or identify evidence of septic systems or cesspools at the subject property.

2.9 Storm Water

Storm water at the subject property percolates through pervious areas or sheet flows to the adjoining parking lots and roadways into the municipal storm sewer system. Storm drains were observed throughout the asphalt-paved parking areas throughout the subject property. According to the key site manager, all storm drains connect to the municipal storm sewer system. Langan did not observe evidence of impact (e.g., sheens, staining) to storm water pathways.

3. SUBJECT PROPERTY HISTORY AND RECORDS REVIEW

The following sections provide summaries of the historical uses of the subject property, and available information regarding documented environmental conditions associated with the historical uses.

3.1 Historical Summary

Langan compiled the following summary of the subject property history based on a review of readily available and reasonably ascertainable sources and interviews. Historical resources are provided in Appendix E.

Table 3-1 Subject Property History

Time Period	Historical Discussion
1890s – 1930s	The subject property is depicted in an urban area consisting of grid-formation blocks with residential and commercial buildings as early as 1892 in Sanborn Maps and aerial photographs. According to Sanborn Maps, the subject property was occupied with about 17, one- to three-story residential buildings throughout the property. The south-central portion of the subject property was labeled "Syracuse Twist Drill Co." and contained a forge shop and machine shop, a carpenter shop, an oil house, and an underground oil tank circa 1892. By 1910, about seven additional residential buildings were visible in the northern part of the subject property and a milling department, coal bins, iron storage and two underground storage tanks identified as 'crude oil tanks; 8,000 & 5,000-gallons' were visible within the larger "Syracuse Twist Drill Co" site located in the south-central part of the subject property.
1950s – Early 1970s	According to the Sanborn Maps and aerial photographs, several modifications were made to the subject property buildings to accommodate more commercial operations between the 1950s and early 1960s. In addition to "Syracuse Twist Drill Co." and its associated operations, additional operations present on the subject property from 1951 to 1971, as identified on Sanborn Maps, included a transformer house, used car sales, an auto yard, artificial flowers and decorations manufacturing facility, forge shop, warehouses, and junk house.
Early 1970s – Present	According to aerial photographs, the subject property was redeveloped circa 1978 with seven residential buildings. According to the 1990 Sanborn map, the subject property was redeveloped with the present-day six, two-story residential building configuration. The city directories indicate numerous residential tenants from 1972 through 2020.

Historical uses of the subject property include a drilling company with a machine shop, forge shop, milling facility, coal bins, a transformer house, USTs, and an oil house; used car sales; an auto yard; manufacturing and warehousing facilities; an auto repair shop; and a junk house from at least 1892 until 1971. Historical operations of the subject property are considered a REC, as inadvertent releases of petroleum products, chemicals, or other hazardous substances resulting from historical operations may have affected soil, groundwater, and/or soil vapor at the subject property.

3.2 Regulatory Database Review

The subject property is identified in the Petroleum Bulk Storage (PBS) as NYSDEC PBS ID No. 7-498947, and in the UST database and NY Spills database under the address 301 – 311 Taylor

Street. Based on a review of the database details, these listings pertain to the southern- and western-adjoining properties, respectively. These listings are discussed further in Section 4.3.1. The environmental database report is attached as Appendix F.

3.3 Prior Report Review

Langan was not provided with prior reports for the subject property.

4. ADJOINING PROPERTIES AND SURROUNDING AREA

The following sections describe current and historical uses of and database listings for adjoining properties and the surrounding area.

4.1 Current Use of Adjoining Properties and Surrounding Area

The current use of adjoining and surrounding properties is summarized in Table 4-1.

Table 4-1 Current Use of Adjoining Properties and Surrounding Area

Direction	Adjoining Properties	Surrounding Area
North	Angelou Terrace apartment complex (100-192 Angelou Terrace)	East Adams Street followed by a parking garage and commercial properties
East	South Townsend Street and Pioneer Homes apartment complex (911-939 South Townsend Street)	Residential properties
South	Latimer Terrace apartment complex (199-101 Latimer Terrace)	East Taylor Street and a railroad followed by vacant land and commercial and residential properties
West	South State Street followed by Roesler Park (201 New Street)	Linden Street followed by commercial, residential and institutional properties

Langan did not observe obvious conditions likely to represent environmental concerns for the subject property from current uses of adjoining or surrounding properties.

4.2 Adjoining Properties and Surrounding Area History

Langan compiled the following summaries of the adjoining properties and surrounding area history based on a review of historical resources and interviews. Historical resources are provided in Appendix E.

Table 4-2 Historical Use of Adjoining Properties

Direction	Adjoining Properties
North	The northern-adjoining property was developed with several, one- to two-story residential buildings and a church as early as 1892 according to Sanborn Maps. By 1910, some of the buildings were replaced by commercial facilities including a junk yard, a fire department building, and a cigar facility. Development continued through the 1950s. By 1968, the property was redeveloped as "Mulberry Square Apartments" which included 381 apartments surrounded by parking lots. By the 1990s, the property was redeveloped to its current configuration which includes 14 one- to two-story residential buildings. The historical industrial uses of the northern-adjoining property are further discussed in Section 4.3.1.
East	The eastern-adjoining property was developed with several, one- to two-story residential buildings and storefronts as early as 1892 according to Sanborn Maps. In the 1938 aerial photograph, the site is occupied with one- and two-story buildings comprising the Pioneer Homes housing community and by 1951, the property is redeveloped with the present-day residential buildings. The configuration of the east-adjoining property remains relatively unchanged through the present day. Langan does not consider the historical use of the eastern-adjoining property an environmental concern for the subject property.

Direction	Adjoining Properties
South	The southern-adjoining property was developed with residential buildings and storefronts and Jackson Street followed by a church on the eastern portion of the property as early as 1892. A shop labeled "Electric Motor Bottling" was also visible in the 1910 Sanborn map. Residential and commercial development continued through the 1960s, including a drycleaner from 1951 to 1961 and a gasoline filling station apparent on Sanborn maps and aerial photographs from 1939 to 1959. According to a 1978 aerial photograph, Jackson Street is no longer visible and the property was redeveloped with residential buildings. By the 1990s, the property was redeveloped to its current configuration which includes 13 one- to two-story residential buildings. Environmental concerns related to the southern-adjoining property are further discussed in Section 4.3.1.
West	The western-adjoining property was developed with several, one- to two-story residential buildings and storefronts as early as 1892 according to Sanborn Maps. Residential and commercial development continued through the 1960s with one structure labeled as "Tire Re-Capping". According to aerial photographs from the 1970s, a park is visible on the west-adjoining property. Sanborn maps appear to mis-map the features at the property from the 1970s through the 1990s. Langan does not consider the historical use of the western-adjoining properties an environmental concern for the subject property.

The surrounding area was developed with mostly residential and mixed residential and commercial buildings by the late 1800s. Between the 1900s and 1970s, the area became increasingly developed with multi-story residential, institutional, and commercial buildings.

The historical operation of the southern-adjoining property as a gasoline filling station is considered a REC, as inadvertent releases of petroleum products, chemicals, or other hazardous substances resulting from historical operations may have affected soil, groundwater, and/or soil vapor at the subject property. Langan does not consider the historical uses of other surrounding area properties an environmental concern for the subject property.

4.3 Regulatory Database Review

Langan reviewed the environmental database report to evaluate if adjoining or surrounding area properties identified in the database report are suspected to represent an environmental concern for the subject property (see Section 8.2). Langan did not consider request and review of the associated regulatory agency files necessary to evaluate potential RECs for the subject property unless discussed in Section 4.3.1 or 4.3.2 below.

4.3.1 Adjoining Properties

Database listings for adjoining properties are summarized as follows.

East Adams Redevelopment - Phase I Area/ Syracuse Police Dept Gas Depot – 100 Angelou Terrace/916 South State Street (northern-adjoining, inferred cross gradient)

The northern-adjoining property was identified in the NY Brownfield database under the name 'East Adams Redevelopment – Phase One Area' and NYSDEC BCP Site No. C734162. An environmental investigation conducted at the subject property in 2023 identified contaminants of concern including metals and perfluorooctanesulfonic acid (PFOS) in soil, total metals,

perfluorooctanoic acid (PFOA) and PFOS in groundwater, and volatile organic compounds (VOC) in soil vapor. The source of PFOS in soil and PFOA and PFOS in groundwater identified at the site was attributed to the quality of historic fill and an unknown off-site source, respectively, the source of total metals in groundwater was attributed to regional groundwater quality, and the source of VOCs in soil vapor was attributed to an unknown off-site source. The NYSDEC determined that remediation is not required for the property to be operated for its intended use (restricted-residential). Based on the available environmental data, it is unlikely this listing represents an environmental concern to the subject property.

Syracuse Housing Auth - Pioneer Homes/Parking Lot – 116-118 Radisson Court/Dablon Court (southeastern- eastern-adjoining, inferred up- and cross gradient)

The property was listed in the NY Spills, UST, AST, Resource Conservation and Recovery Act (RCRA) small quantity generator (SQG), and Manifest databases. NYSDEC Spill No. 2005041 was reported on 1 September 2020 after an automobile gasoline tank leaked onto the asphalt parking lot. The spill was cleaned using speedy-dri and the spill was closed on 13 May 2022. NYSDEC Spill No. 9401370 was reported on 28 April 1994 when accumulated used oil was identified in a storm drain. The sludge/oil was removed and the spill was closed on the same day.

The facility was listed as a RCRA generator in 2008 for the generation of corrosive waste (D002); no violations were identified. NAICS code associated with the facility includes Administration of Housing Programs (92511).

The facility is identified as an unregulated/closed facility under NYSDEC PBS ID No. 7-498947. This listing is associated with the larger Pioneer Homes and is associated with two closed – removed 5,000-gallon and 10,000-gallon No. 2 fuel oil USTs that were installed in 1984 and closed in 1993 and 1994, respectively. The database identified 2,500-gallon No. 2 fuel oil ASTs as 'aboveground – in contact with soil' installed in 1984 and closed in 2010.

Based on the closed status of the spills and tanks, absence of violations associated with the RCRA waste generations and inferred gradient from the subject property, this facility is not considered a REC.

City Owned Apartment Complex – 301-311 East Taylor Street/South State Street/New Street (southern-adjoining, inferred cross gradient)

The property was listed in the NY Spills and LTANKS databases. NYSDEC Spill No. 92058359 was reported on 10 October 1992 when a leaking 500 gallon tank was identified during excavation for a new sewer line. Petroleum-impacted soil was excavated and staged for disposal, and the spill was closed on 26 January 1993. NYSDEC Spill No. 2400040, reported on 2 April 2024 when impacted soil and groundwater was observed during a Phase II investigation. The listing indicated that impacts included benzene, toluene, ethylbenzene, and xylenes (BTEX) compounds and were likely associated with the former use of the property as a gasoline station in the 1950s. Cleanup is pending at the property and the spill remains open. The historical use and documented impacts at the south-adjoining property may have impacted soil, groundwater, and/or soil vapor at the subject property and this adjoining property is considered a REC.

4.3.2 Surrounding Area

Langan evaluated each of the database listings for surrounding area properties (see Section 8.2). Those warranting further discussion in the context of potential to represent an environmental concern for the subject property are discussed below.

Manhole 7-1 – 907 South Townsend Street (approximately300 feet northeast, inferred up- and cross gradient)

This site is listed in the NY Spills database under NYSDEC Spill No. 2400382, which was report on April 11, 2024 after a sheen was observed in a manhole. The spill is still listed as open; however, the listing indicates that Clean Harbors, an environmental remediation company, was called to the scene to clean the spill and no further action is needed. Based on the documented remediation of the spill and cross gradient location with respect to the subject property, this listing is not considered a REC.

East Adams Redevelopment – Phase II Area/Salvation Army/Spill Number 9601904 – 1105-1117 South State Street (approximately 500 feet south, inferred cross gradient)

This facility was identified in the NY Brownfields database under the name 'East Adams Redevelopment – Phase II Area' and BCP Site No. C734163. The site was developed as early as the 1890s and was historically occupied by a carriage manufacturing and painting facility, a bridge manufacturing facility with two gasoline tanks, a clothing factory, a scrap metal yard, a gasoline station with gasoline storage tanks, a paper baling facility, and automobile repair facility. The site is also listed in the UST, UST Finder, UST Finder Release, LTANKS, and NY Spills databases. Environmental investigations conducted between 1996 and 2023 identified contaminants of concern including VOCs, SVOCs and metals in soil; VOCs, SVOCs, and total metals in groundwater; and petroleum-related VOCs in soil vapor. There is one open NY Spill associated with this site, Spill No. 2208975, reported 6 February 2023 during a Phase II for petroleum-impacted material encountered between 5 and 15 feet bgs.

The site will be remediated in accordance with a NYSDEC-approved RAWP. Based on the distance and cross-gradient location of the site with respect to the subject property; therefore, this listing does not present an environmental concern for the subject property.

Steam Heat Syr University/Steam Station/Syracuse University – Steam Station/Steam Station/SU Chilled Water Plant – 500 Taylor Street (approximately 510 feet southeast, inferred cross gradient)

This facility was identified in the LTANKS, UST, Chemical Bulk Storage (CBS), AST, CBS AST, NY Spills, RCRA NonGen, E-Manifest, NY Manifest and NJ Manifest databases. The site is listed under NYSDEC PBS Facility ID 7-180602 and CBS Facility ID 7-000152. The following petroleum and chemical bulk stored is listed in associated with this facility:

Tank Type	Tank No.	Volume (gallons)	Content	Status
UST	001	30,000	No. 2 Fuel Oil	Closed
UST	002	30,000	No. 2 Fuel Oil	Closed
UST	003	15,000	No. 2 Fuel Oil	Closed
UST	005	30,000	No. 2 Fuel Oil	In-Service
UST	006	30,000	No. 2 Fuel Oil	In-Service
UST	007	30,000	No. 2 Fuel Oil	In-Service
UST	008	30,000	No. 2 Fuel Oil	In-Service
AST	009	300	kerosene	closed-removed
AST	002	1,100	N/A	closed-removed
AST	003	500	N/A	closed-removed
CBS AST	003	500	sodium hypochlorite	In-Service
CBS AST	002	1,100	sulfuric acid	N/A
CBS AST	004	1,000	dichlorofluoromethane	In-Service
CBS AST	001	1,500	sulfuric acid	In-Service
CBS AST	003	1,000	Ethylenediamine Tetracetic acid (EDTA)	In-Service
CBS AST	002	1,000	ETDA	In-Service

Ten NY Spills or LTANK listings are listed in association with this facility and are related to tank test failure, tank leaks, and/or discovery of petroleum-impacted soil during excavation activity. All spills have been remediated to the satisfaction of the NYSDEC and administratively closed.

The site is listed as a Large Quantity Generator (LQG) (1992, 1994), Small Quantity Generator (SQG) (1987), Conditionally Exempt Small Quantity Generator (CESQG) (2006, 2007, 2009, 2018) and verified non generator (2019) of ignitable wastes (D001), corrosive wastes (D002), and spent halogenated wastes (F001 and F002). Manifests for the disposal of these wastes were identified in the NY and NJ Manifests databases from February 1994 to October 2013; no violations were identified.

Based on the distance and cross gradient location with respect to the subject property, closed status of spills and LTANK listings and absence of violations related to RCRA waste generation, this facility is not considered a REC.

5. FINDINGS, OPINIONS AND CONCLUSIONS

Langan has performed a Phase I ESA in conformance with the scope and limitations of ASTM E1527-21 for the East Adams Redevelopment Phase Three Area property located at 200 Chavez Terrace in Syracuse, New York, the subject property. Any exceptions to, or deletions from, this practice ASTM E1527-21 are described in Section 8 of this report.

This assessment has revealed the following RECs, CRECs, HRECs, de minimis conditions, and significant data gaps in connection with the subject property as presented in Table 5-1.

Table 5-1 Findings, Opinions and Conclusions

ASTM E1527-21 Scope Items
Recognized Environmental Conditions (RECs)
Historical Use of the Subject Property: Historical uses of the subject property include a drilling company with a machine shop, forge shop, milling facility, coal bins, a transformer house, USTs, and an oil house; used car sales; an auto yard; manufacturing and warehousing facilities; an auto repair shop; and a junk house from at least 1892 until 1971. Historical operations of the subject property are considered a REC, as inadvertent releases of petroleum products, chemicals, or other hazardous substances resulting from historical operations may have affected soil, groundwater, and/or soil vapor at the subject property.
Historical Use and Documented Contamination at the Southern Adjoining Property: Historical operations on the south-adjoining property included an electric motor bottling facility in the 1910s, a gasoline station in the 1950s, a drycleaner in the 1950s and early 1960s, and a junk yard from the 1910s through the 1960s. The property was listed in the NY Spills database under NYSDEC Spill No. 2400040, which was reported on 2 April 2024 after soil and groundwater impacted with BTEX were identified during a subsurface investigation. Cleanup is pending, and the spill remains open. The historical use and documented impacts at the south-adjoining property may have impacted soil, groundwater, and/or soil vapor at the subject property and this adjoining property is considered a REC.
Controlled Recognized Environmental Conditions (CRECs)
Langan did not identify CRECs.
Historical Recognized Environmental Conditions (HRECs)
Langan did not identify HRECs.
De Minimis Conditions
Langan did not identify de minimis conditions.
Significant Data Gaps
Langan did not identify significant data gaps.
Non-ASTM E1527-21 Scope Items
Business Environmental Risks (BERs)
Non-Native Fill: According to the USDA data for Onondaga County, the subject property is likely underlain by a layer of non-native fill. Non-native fill found in urban environments typically contains ash, demolition debris, and/or municipal waste products and may contain contaminants (e.g., SVOCs or metals) at concentrations above applicable regulatory standards. The occurrence of historic fill does not trigger any regulatory obligations or reporting requirements but may require implementation of soil handling and management procedures during site redevelopment to address excavation, re-use, handling, and off-site

ASTM E1527-21 Scope Items
disposal.
Additional Findings
The northern adjoining property (East Adams Redevelopment - Phase I Area/ Syracuse Police Dept Gas Depot) located at 100 Angelou Terrace was identified in the NY Brownfields database under the name 'East Adams Redevelopment – Phase One Area' and NYSDEC BCP Site No. C734162. An environmental investigation conducted at the subject property in 2023 identified contaminants of concern including metals and PFOS in soil, total metals, PFOA and PFOS in groundwater, and VOCs in soil vapor. A BCP application was subsequently prepared in an effort to receive confirmation from NYSDEC that remediation was not required for the site. Based on the denial letter from NYSDEC, the site does not require remediation and therefore is not considered a REC. The southeastern adjoining property (Syracuse Housing Auth - Pioneer Homes/Parking Lot) located at 116-118 Radisson Court was identified in the NY Spills, UST, RCRA SQG, and manifest databases. Based on the distance and cross-gradient location with respect to the subject property, closed status of the spill and tanks associated with the site, and absence of violations related to RCRA generation at the site, it is unlikely that potential releases at the site would have impacted the subject property; and is therefore is not considered a REC. The property (East Adams Redevelopment – Phase II Area/Salvation Army/Spill Number 9601904) is located at 1105-1117 South State Street and was identified in the NY Brownfields database as East Adams Redevelopment – Phase Two Area and NYSDEC BCP Site No. C734163. Contamination identified at the site during previous environmental investigations included VOCs, SVOCs and metals in soil; VOCs, SVOCs, and total metals in groundwater; and petroleum-related VOCs in soil vapor. The site will be remediated in accordance with a NYSDEC-approved RAWP. Based on the distance and cross-gradient location, it is unlikely that potential releases or contamination would have impacted the subject property; and is therefore not considered a REC. The listing (Manhole 7-1) located at 907 South Townsend Street was identified in the NY Spills database as an open spill that was called in when a sheen was observed in a manhole by National Grid. Based on the listing information, Clean Harbors, an environmental remediation company, was called to the scene to clean the spill and no further action is needed. Based on the distance and cross-gradient location, it is unlikely that potential releases or contamination would have impacted the subject property; and is therefore not considered a REC. The property (Steam Heat Syr University/Steam Station/Syracuse University – Steam Station/Steam Station/SU Chilled Water Plant) located at 500 East Taylor Street was identified in the LTANKS, UST, AST, CBS, AST, NY Spills, RCRA, NonGen, E-Manifest, NY Manifest and NJ Manifest databases. Based on the distance and cross-gradient location with respect to the subject property, closed status of the spill and tanks associated with the site, and absence of violations related to RCRA generation at the site, it is unlikely that potential releases at the site would have impacted the subject property; and is therefore not considered a REC. The RECs and BER described above will be further investigated during a Phase II Environmental Site Investigation (ESI).

6. ENVIRONMENTAL PROFESSIONAL STATEMENT

I declare that to the best of my professional knowledge and belief, I meet the definition of Environmental Professional as defined in Section 312.10 of 40 CFR Part 312 and I have the specific qualifications based on my education, training, and experience to assess a property of the nature, history, and setting of the subject property. I have developed and performed all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

Brian Gochenaur, QEP
Associate Principal/Vice President (Environmental Professional)

Resumes outlining the qualifications of the project team and the Environmental Professional are included in Appendix G.

7. REFERENCES

Langan used the following sources to complete this Phase I ESA.

- ASTM E1527-21, Standard Practice for Environmental Property Assessments: Phase I Environmental Property Assessment Process, published 16 November 2021
- Department of Environmental Conservation Bulk Storage Database Search, http://www.dec.ny.gov/cfmx/extapps/derexternal/index.cfm?pageid=4, searched 30 August 2024
- Department of Environmental Conservation Spills Incidents Database Search, http://www.dec.ny.gov/cfmx/extapps/derexternal/index.cfm?pageid=2, searched 30 August 2024
- EDR, Inc., Radius Map Report with GeoCheck, 28 August 2024
- EDR, Inc., City Directory Image Report, 1 December 2024
- EDR, Inc., Aerial Photographs, 28 August 2024
- EDR, Inc., Historical Topographic Map Report, 28 August 2024
- EDR, Inc., Sanborn Map Report, 29 August 2024
- EDR, Inc., Environmental Lien Report, 29 August 2024
- Interstate Technology and Regulatory Council, Per and Polyfluoroalkyl Substances Technical and Regulatory Guidance, July 2023
- PFAS Exchange GIS Webviewer, https://experience.arcgis.com/experience/12412ab41b3141598e0bb48523a7c940/
- United States Census Bureau, North American Industry Classification System, https://www.census.gov/naics/
- United States Geological Survey, Fisher, Isachsen, and Rickard, 1970, Geologic Map of New York, Finger Lakes Sheet
- US EPA 40 CFR Part 302 (EPA-HQ-OLEM-2019-0341; FRL-7204-03-OLEM), RIN 2050-AH09, Designation of Perfluorooctanoic Acid (PFOA) and Perfluorooctanesulfonic Acid (PFOS) as CERCLA Hazardous Substances, Final Rule, 8 May 2024
- US EPA ECHO database: http://echo.epa.gov/facilities searched 16 November 2024
- US EPA ECHO: PFAS Analytic Tools - https://echo.epa.gov/trends/pfas-tools
- US EPA ENVIROFACTS database: https://www3.epa.gov/enviro/ searched 30 August 2024
- US EPA MyProperty database: https://www3.epa.gov/enviro/facts/myproperty/ searched 30 August 2024
- Onondaga County Assessor's Office database: https://www.townofonondaga.gov/departments/assessor searched 30 August 2024
- Onondaga County Clerk Digital Document database, http://www.ongov.net/clerk/DigitalDocuments.html, searched 30 August 2024

- Onondaga County Department of Finance Office of Real Property Services database, https://ocfintax.ongov.net/lmate/search.aspx, searched 30 August 2024

Table 7-1 Dates of Assessment Components

COMPONENT	DATE
Interviews	3 September 2024
Review of government records	28 August 2024
Site reconnaissance	3 September 2024
Declaration by Environmental Professional	24 January 2025

8. LIMITATIONS AND DEFINITIONS

This Phase I ESA report was prepared for Client and is intended to be used in its entirety. Excerpts taken from this report are not necessarily representative of the assessment findings. The Client is the sole intended beneficiary of the report. The user requested no special terms or conditions regarding this Phase I ESA.

Langan's scope of services, which is described in Section 1.2 and in the contract executed between Langan and the Client, was limited to that agreed to with the Client/user and no other services beyond those explicitly stated are implied. To the extent possible, the services performed and agreed upon for this Phase I ESA are consistent with the guidelines of ASTM E1527-21.

This report is not intended to be an exhaustive assessment of the subject property. The purpose of the Phase I ESA is to reduce uncertainty about unknown conditions at the subject property. No environmental site assessment can wholly eliminate uncertainty regarding the potential for RECs in connection with a subject property. Therefore, Langan cannot "verify", "insure", "certify", or "guarantee" that the subject property is free of environmental concerns.

No expressed or implied representation or warranty is included or intended in this report, except that our services were completed using the care and skill ordinarily followed by professionals providing similar services under similar circumstances in similar locations at the same point in time.

The conclusions provided in this report are based solely on information obtained through completing the standard activities required by ASTM E1527-21 and are intended exclusively for the purpose stated herein, at the specified subject property, as it existed at the point in time the assessment was completed. The conclusions provided in this report do not apply to conditions and features of which Langan was not made aware of through good faith efforts to complete the activities required by ASTM E1527-21 and did not have the opportunity to evaluate.

8.1 ASTM Definitions

The following definitions are provided in ASTM E1527-21 and presented below for reference. This section is not a comprehensive list of definitions provided in ASTM E1527-21 and is intended to summarize those pertinent to this Phase I ESA report.

Activity and use limitations (AULs): legal or physical restrictions or limitations on the use of, or access to, a site or facility: (1) to reduce or eliminate potential exposure to hazardous substances or petroleum products in the soil, soil vapor, groundwater, and/or surface water on the property, or (2) to prevent activities that could interfere with the effective-ness of a response action, in order to ensure maintenance of a condition of no significant risk to public health or the environment. These legal or physical restrictions, which may include institutional and/or engineering controls, are intended to prevent adverse impacts to individuals or populations that may be exposed to hazardous substances and petroleum products in the soil, soil vapor, groundwater, and/or surface water on a property.

Adjoining properties: any real property or properties the border of which is contiguous or partially contiguous with that of the subject property, or that would be contiguous or partially contiguous with that of the subject property but for a street, road, or other public thoroughfare separating them.

All Appropriate Inquiries: that inquiry constituting all appropriate inquiries into the previous ownership and uses of the subject property consistent with good commercial and customary practice as defined in CERCLA, 42 U.S.C.§ 9601(35)(B) and 40 C.F.R. Part 312, that will qualify a party to a commercial real estate transaction for one of the threshold criteria for satisfying the LLPs to CERCLA liability (42U.S.C. §§ 9601(35)(A) & (B), § 9607(b)(3), § 9607(q), and§ 9607(r)), assuming compliance with other elements of the defense.

Approximate minimum search distance: the area for which records must be obtained and reviewed pursuant to ASTM E1527-21 Section 8 subject to the limitations provided in that section. This may include areas outside the subject property and shall be measured from the nearest subject property boundary. This term is used in lieu of radius to include irregularly shaped properties.

Business environmental risk (BER): a risk which can have a material environmental or environmentally-driven impact on the business associated with the current or planned use of commercial real estate, not necessarily related to those environmental issues required to be investigated in this practice. Consideration of BER issues may involve addressing one or more non-scope considerations.

Controlled recognized environmental condition (CREC): recognized environmental condition affecting the subject property that has been addressed to the satisfaction of the applicable regulatory authority or authorities with hazardous substances or petroleum products allowed to remain in place subject to implementation of required controls (for example, activity and use limitations or other property use limitations).

Data gap: a lack of or inability to obtain information required by this practice despite good faith efforts by the environmental professional to gather such information. Data gaps may result from incompleteness in any of the activities required by this practice, including, but not limited to, site reconnaissance (for example, an inability to conduct the site visit), and interviews (for example, an inability to interview the key site manager, regulatory officials, etc.).

De minimis condition: a condition related to a release that generally does not present a threat to human health or the environment and that generally would not be the subject of an enforcement action if brought to the attention of appropriate governmental agencies. A condition determined to be a de minimis condition is not a recognized environmental condition nor a controlled recognized environmental condition.

Engineering controls: physical modifications to a site or facility (for example, capping, slurry walls, or point of use water treatment) to reduce or eliminate the potential for exposure to hazardous substances or petroleum products in the soil or groundwater on a property. Engineering controls are a type of activity and use limitation (AUL).

Environment: environment shall have the same meaning as the definition of environment in CERCLA 42 U.S.C. § 9601(8).

Historical recognized environmental condition (HREC): previous release of hazardous substances or petroleum products affecting the subject property that has been addressed to the satisfaction of the applicable regulatory authority or authorities and meeting unrestricted use criteria established by the applicable regulatory authority or authorities without subjecting the subject property to any controls (for example, activity and use limitations or other property use limitations). A historical recognized environmental condition is not a recognized environmental condition.

Institutional controls (IC): a legal or administrative mechanism (for example, "deed restrictions," restrictive covenants, easements, or zoning) on the use of, or access to, a site or facility to (1) reduce or eliminate potential exposure to hazardous substances or petroleum products in the soil or groundwater on the property, or (2) to prevent activities that could interfere with the effectiveness of a response action, in order to ensure maintenance of a condition of no significant risk to public health or the environment. An institutional control is a type of activity and use limitation (AUL).

Key site manager: the person identified by the owner or operator of a subject property as having good knowledge of the uses and physical characteristics of the subject property.

Material threat: obvious threat which is likely to lead to a release and that, in the opinion of the environmental professional, would likely result in impact to public health or the environment.

Obvious: that which is plain or evident; a condition or fact that could not be ignored or overlooked by a reasonable observer.

Property use limitation: limitation or restriction on current or future use of a property in connection with a response to a release, in accordance with the applicable regulatory authority or authorities that allows hazardous sub-stances or petroleum products to remain in place at concentrations exceeding unrestricted use criteria.

Reasonably ascertainable: information that is (1) publicly available, (2) obtainable from its source within reasonable time and cost constraints, and (3) practically reviewable.

Recognized environmental conditions: (1) the presence of hazardous substances or petroleum products in, on, or at the subject property due to a release to the environment; (2) the likely presence of hazardous substances or petroleum products in, on, or at the subject property due to a release or likely release to the environment; or (3) the presence of hazardous substances or petroleum products in, on, or at the subject property under conditions that pose a material threat of a future release to the environment. For the purposes of this definition, "likely" is that which is neither certain nor proved, but can be expected or believed by a reasonable observer based on the logic and/or experience of the environmental professional, and/or available evidence, as stated in the report to support the opinions given therein.

Release: a release of any hazardous substance or petroleum product shall have the same meaning as the definition of "release" in CERCLA 42 U.S.C. § 9601(22). There are a number of statutory exclusions from the definition of release that may impact the environmental professional's opinions and conclusions, such as the normal application of fertilizer.

Significant data gap: a data gap that affects the ability of the environmental professional to identify a recognized environmental condition.

Site reconnaissance: that part that is contained in Section 9 of ASTM E1527-21 and addresses what should be done in connection with the site visit. The site reconnaissance includes, but is not limited to, the site visit done in connection with such a Phase I Environmental Site Assessment.

Site visit: the visit of the subject property during which observations are made constituting the site reconnaissance section of this practice.

Subject property: the property that is the subject of the environmental site assessment described in this practice.

User: the party seeking to use ASTM E1527-21 to complete an environmental site assessment of the subject property.

8.2 Standard Environmental Record Sources

Langan reviewed an environmental database search report prepared by an environmental database search provider for the subject property and surrounding area. The database search report includes a listing of properties identified on select federal, state, local and tribal standard source environmental databases within the approximate minimum search radii outlined in ASTM E1527-21. This information was supplied to Langan by the environmental database search provider, and to the environmental database search provider by government sources; therefore, neither Langan nor the environmental database search provider can verify the completeness and accuracy of the database information. Appendix F contains a copy of the report, with specific source and property descriptions, and the dates of the last update for each database searched. Langan reviewed the database search report on a record-by-record basis to evaluate if certain properties identified in the database report are likely to represent an environmental concern for the subject property. The evaluation criteria included factors such as distance, groundwater gradient, nature of the listing, and regulatory status. Unless specifically discussed in the body of this report, the facilities listed on the database do not appear to represent an environmental concern to the subject property.

Appendix A Figures

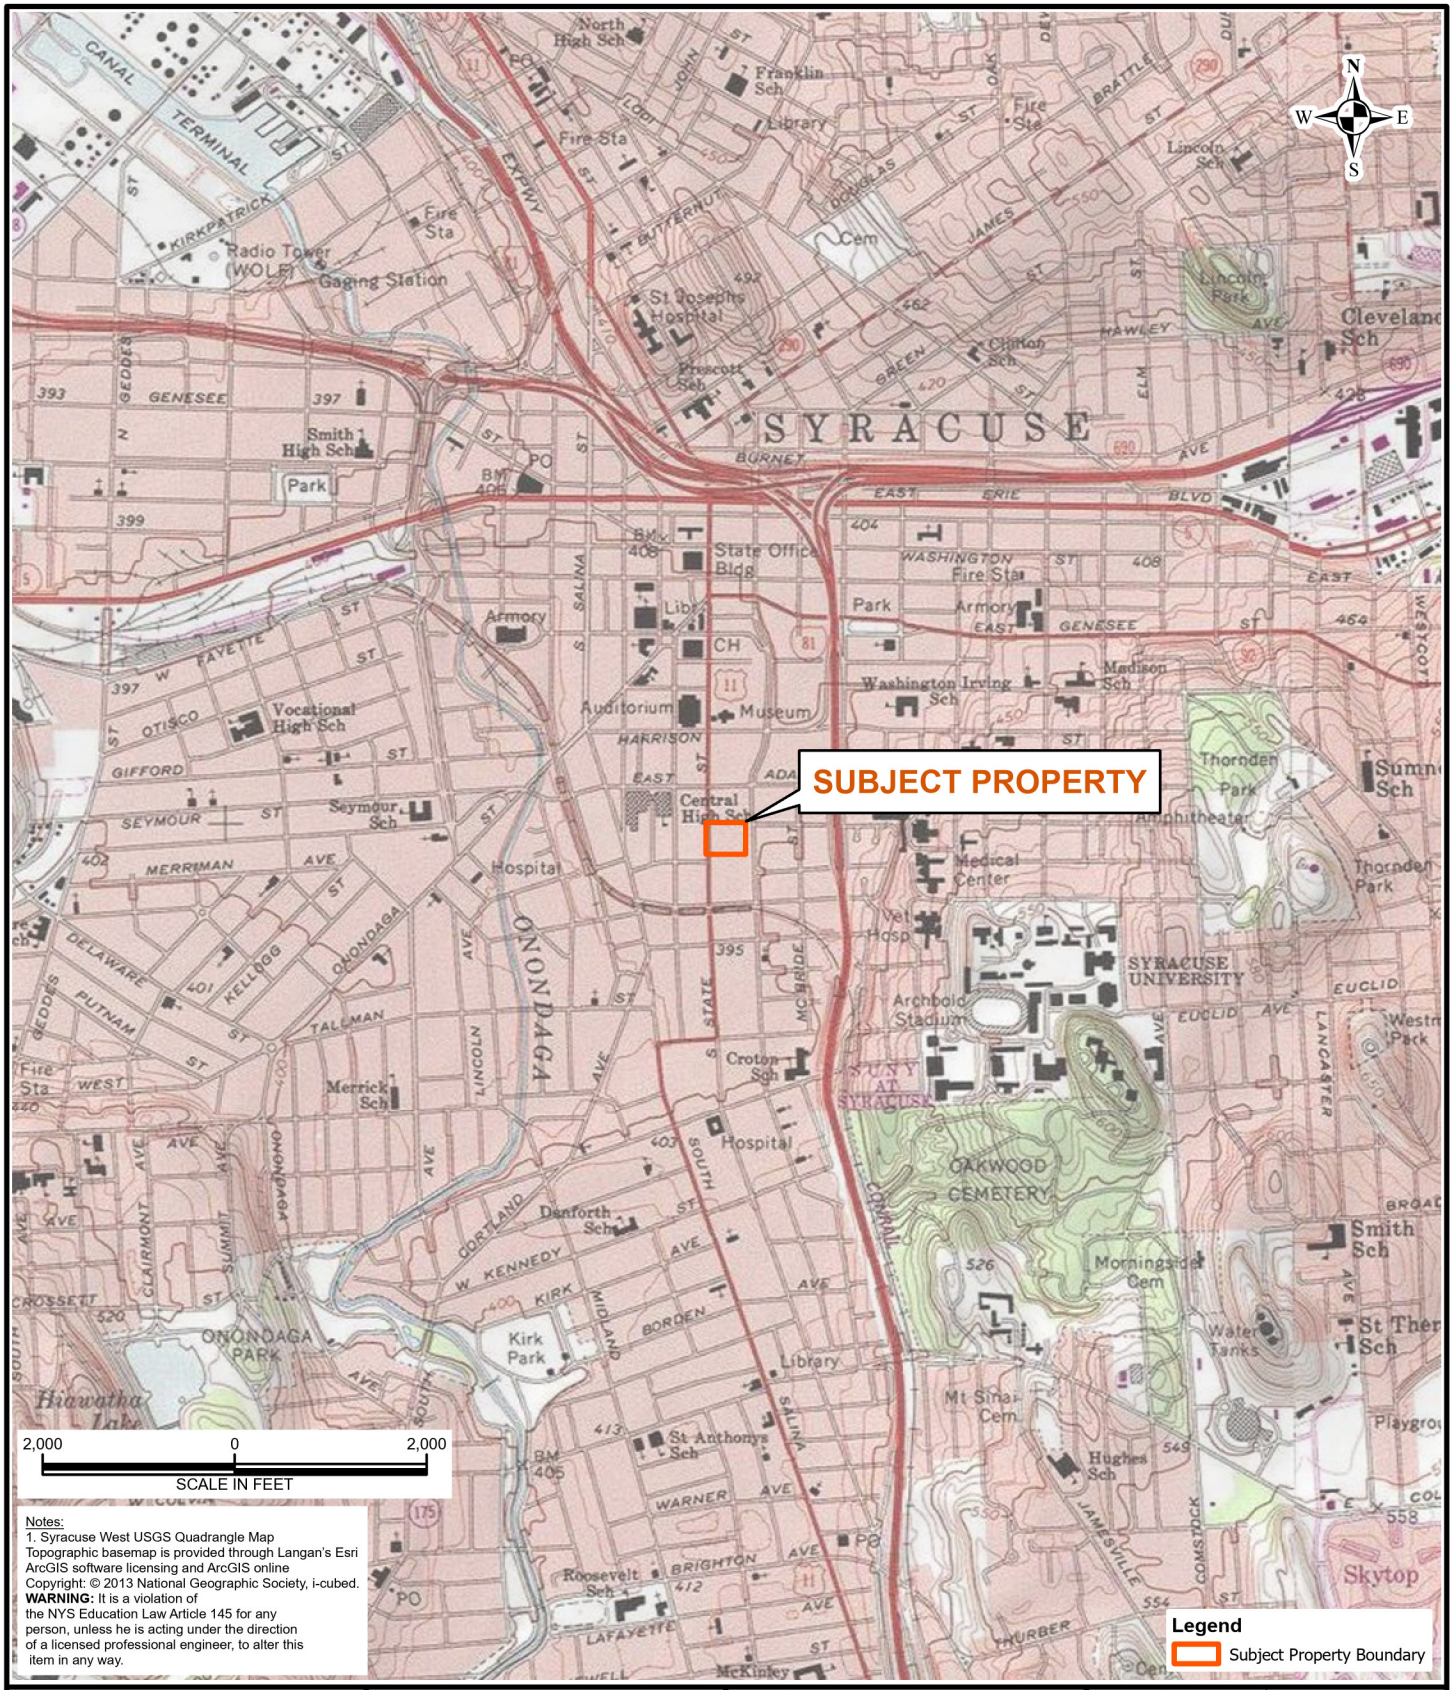

Notes:
1. Syracuse West USGS Quadrangle Map Topographic basemap is provided through Langan's Esri ArcGIS software licensing and ArcGIS online Copyright: © 2013 National Geographic Society, i-cubed.
WARNING: It is a violation of the NYS Education Law Article 145 for any person, unless he is acting under the direction of a licensed professional engineer, to alter this item in any way.

LANGAN
Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C.
368 Ninth Avenue, 8th Floor
New York, NY 10001-2727
T: 212.479.5400 F: 212.479.5444
www.langan.com

Project
EAST ADAMS REDEVELOPMENT PHASE THREE AREA
200 CHAVEZ TERRACE
BLOCK No. 06, p/o LOT No. 01.0
SYRACUSE
ONONDAGA COUNTY NY

Figure Title
SUBJECT PROPERTY LOCATION MAP

Project No.	Figure
170784004	1
Date: 1/9/2025	
Scale: 1" = 2,000 feet	
Drawn By: BLA	

© 2025 Langan

Path: \\langan.com\data\NYC\data7\170859701\Project Data\ArcGIS\APRX\170859701\170859701.aprx

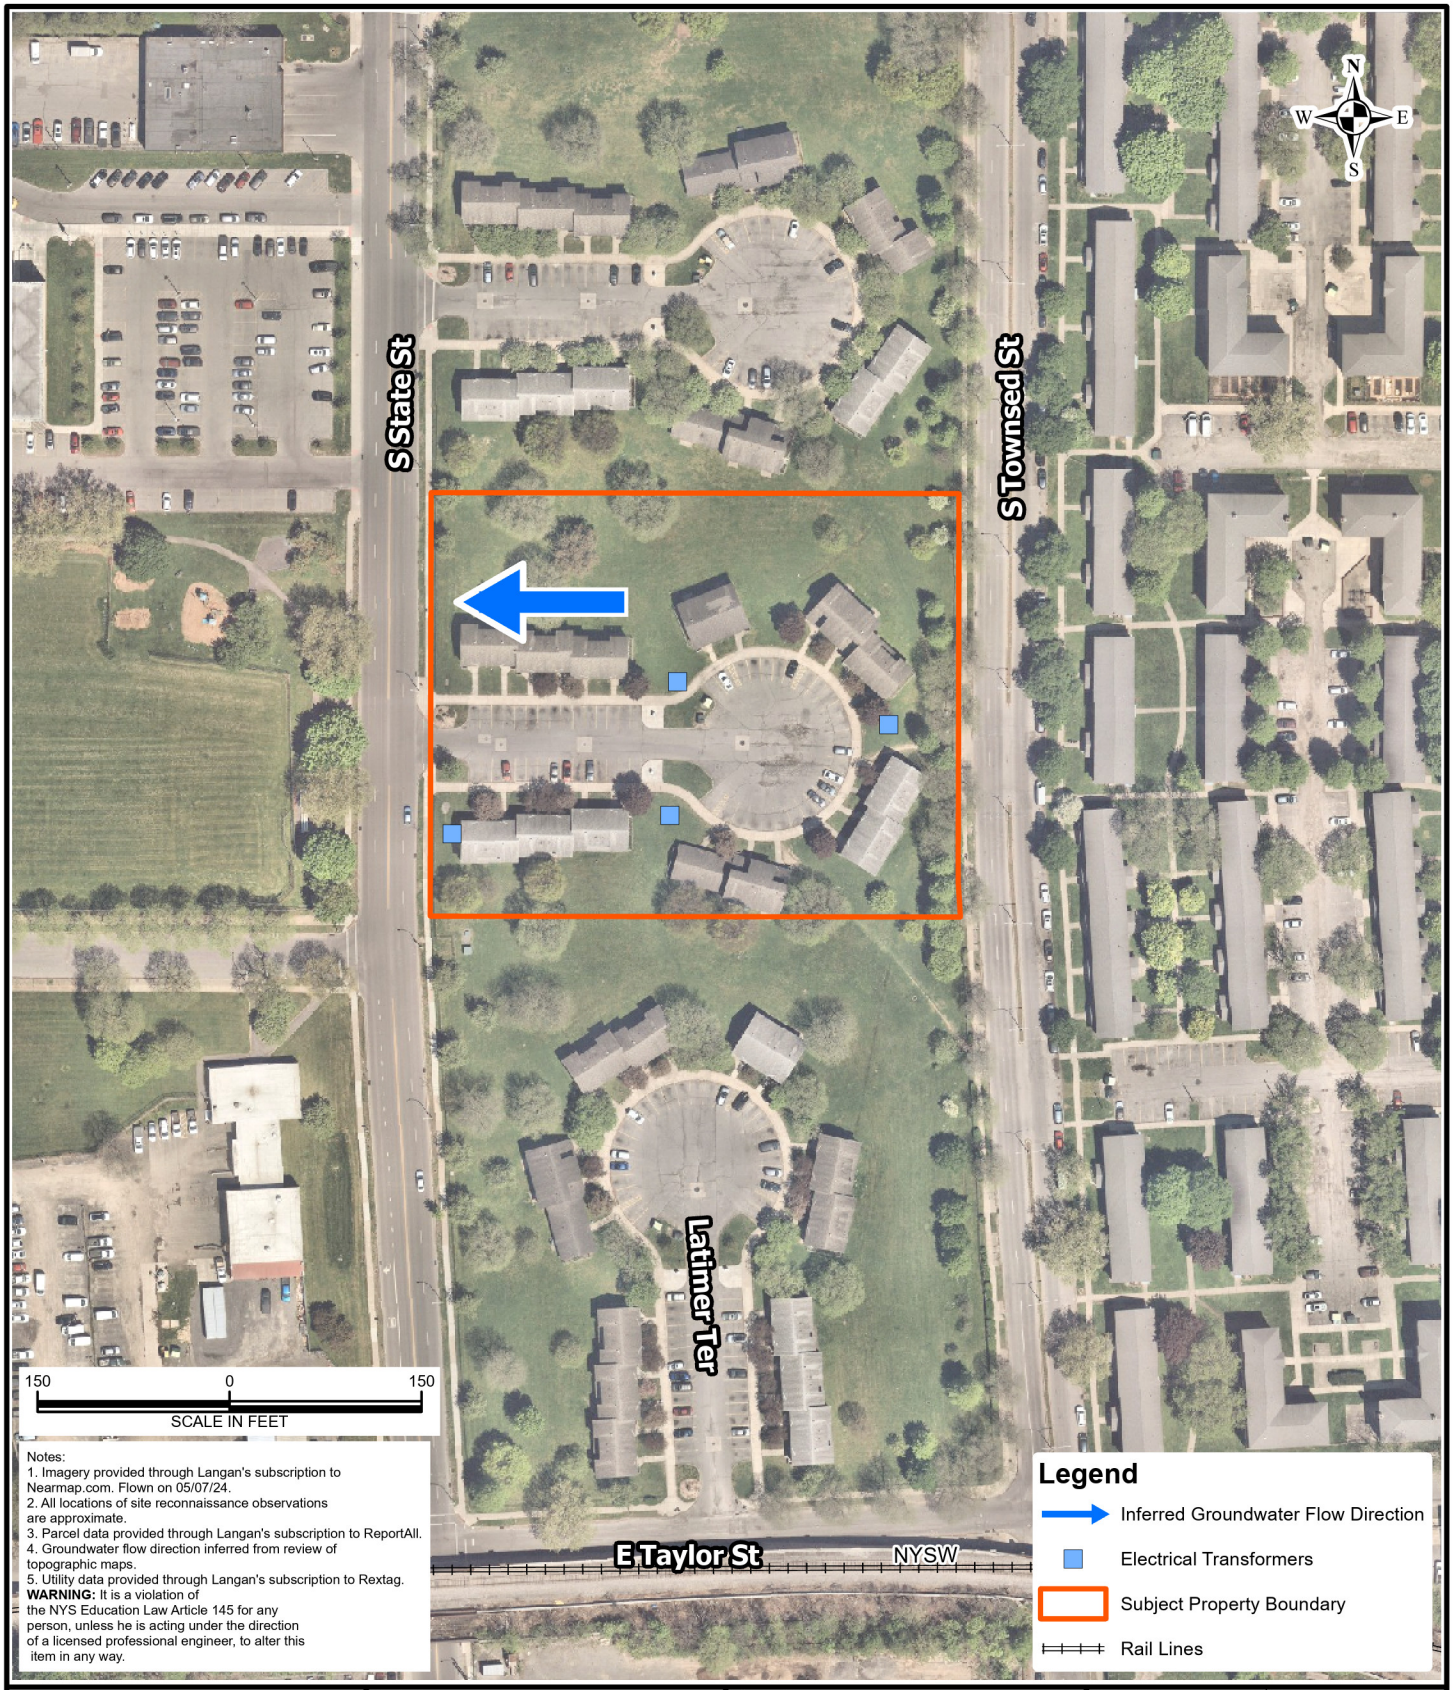

Notes:
1. Imagery provided through Langan's subscription to Nearmap.com. Flown on 05/07/24.
2. All locations of site reconnaissance observations are approximate.
3. Parcel data provided through Langan's subscription to ReportAll.
4. Groundwater flow direction inferred from review of topographic maps.
5. Utility data provided through Langan's subscription to Rextag.

WARNING: It is a violation of the NYS Education Law Article 145 for any person, unless he is acting under the direction of a licensed professional engineer, to alter this item in any way.

LANGAN

Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C.

368 Ninth Avenue, 8th Floor
New York, NY 10001-2727

T: 212.479.5400 F: 212.479.5444
www.langan.com

Project
EAST ADAMS REDEVELOPMENT PHASE THREE AREA
200 CHAVEZ TERRACE
BLOCK No. 06, p/o LOT No. 01.0
SYRACUSE
ONONDAGA COUNTY NY

Figure Title
SUBJECT PROPERTY LAYOUT

Project No.	170784004
Date	1/9/2025
Scale	1" = 150 feet
Drawn By	BLA

Figure
2

© 2025 Langan

Path: \\langan.com\data\NYC\data7\170859701\Project Data\ArcGIS\APRX\170859701\170859701.aprx

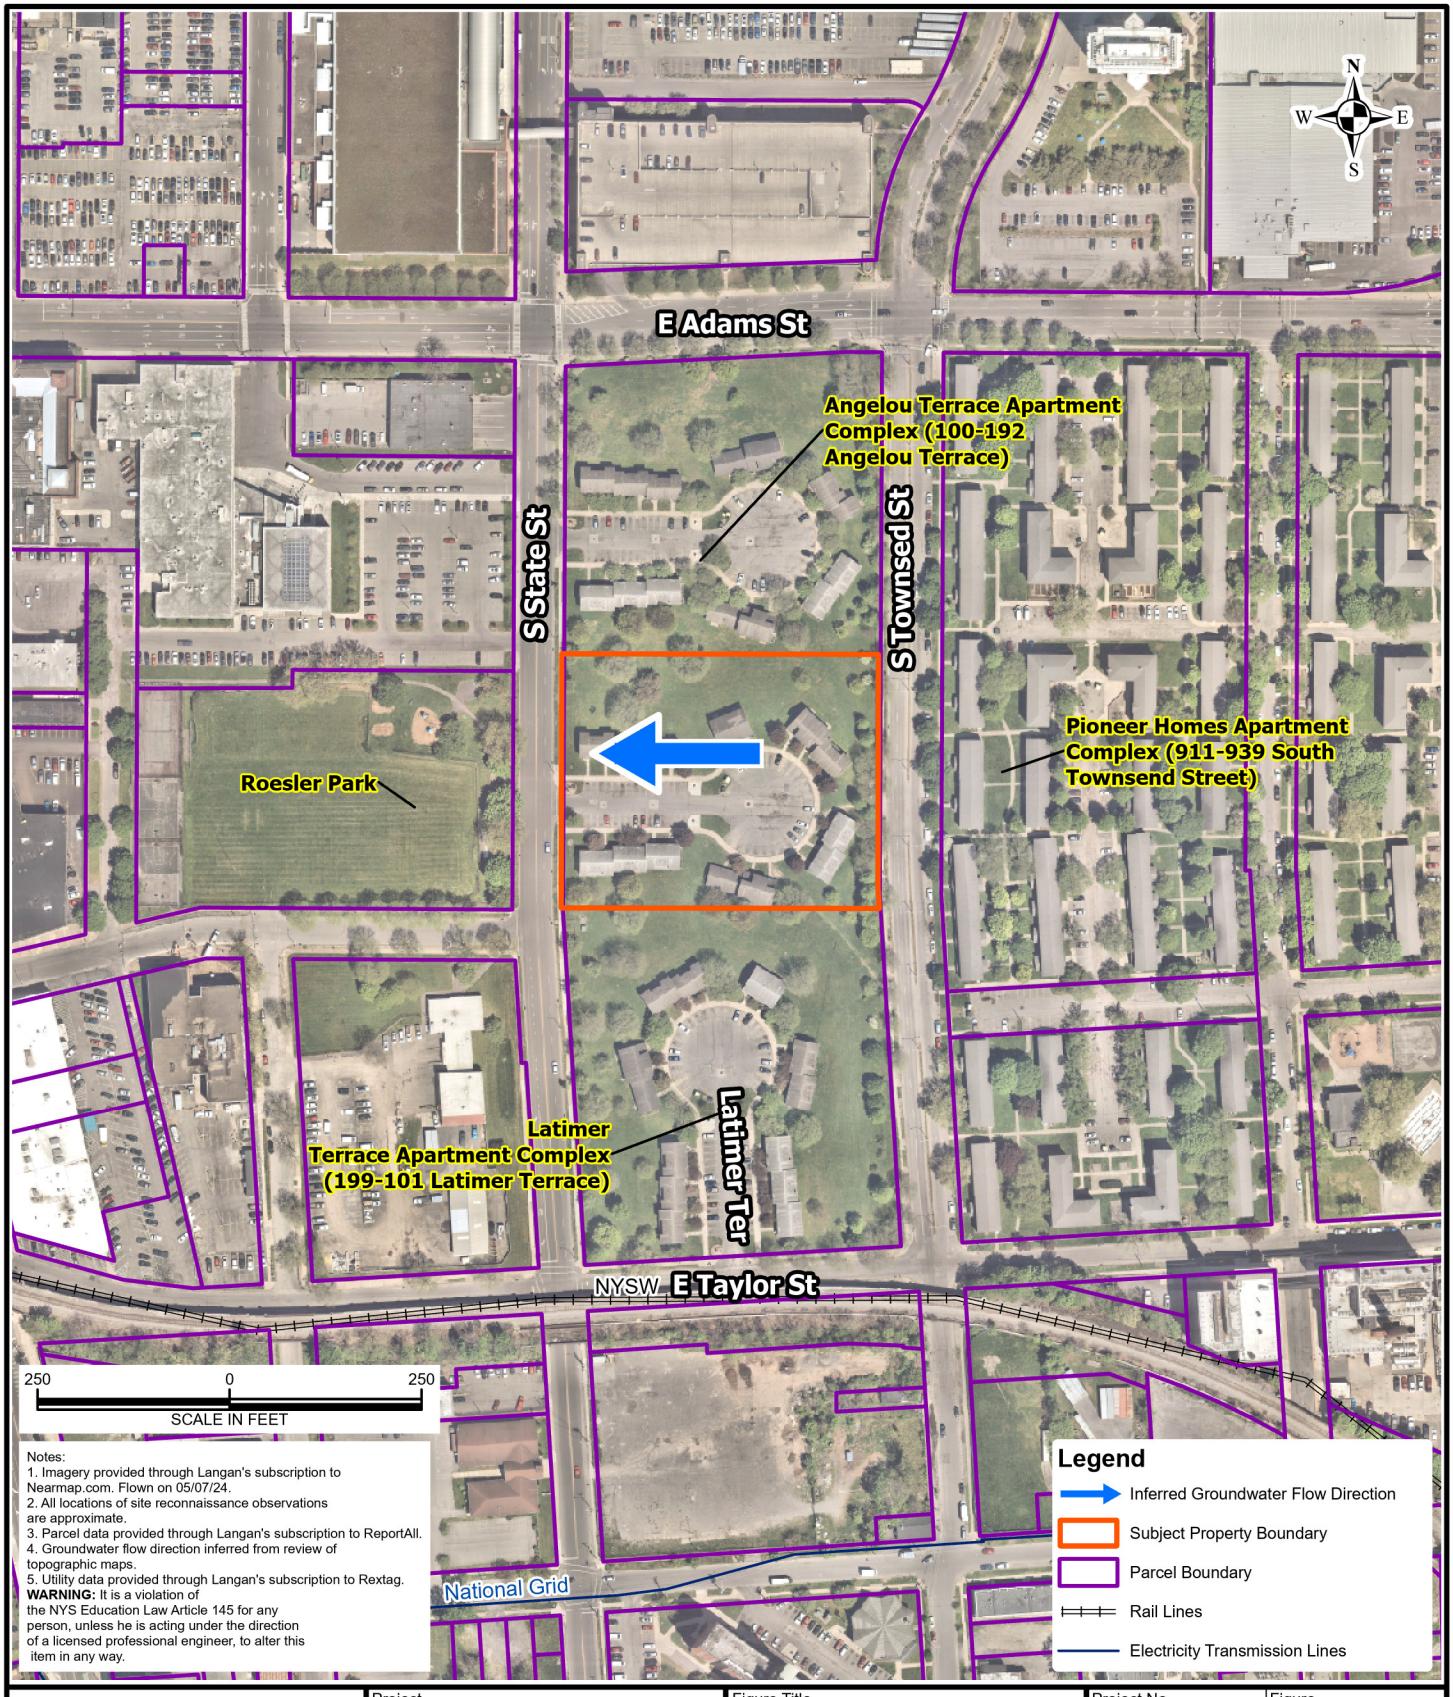

LANGAN
Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C.
368 Ninth Avenue, 8th Floor
New York, NY 10001-2727
T: 212.479.5400 F: 212.479.5444
www.langan.com

Project
EAST ADAMS REDEVELOPMENT PHASE THREE AREA
200 CHAVEZ TERRACE
BLOCK No. 06, p/o LOT No. 01.0
SYRACUSE
ONONDAGA COUNTY NY

Figure Title
NEARBY PROPERTIES MAP

Project No.	170784004
Date	1/9/2025
Scale	1" = 250 feet
Drawn By	BLA

Figure
3

© 2025 Langan

Path: \\langan.com\data\NYC\data7\170859701\Project Data\ArcGIS\APRX\170859701\170859701.aprx

Appendix B Agency Records and Other Reports

Appendix B Agency Records and Other Reports

REZONE SYRACUSE
A Citywide Zoning Update

REZONE SYRACUSE ZONING MAP

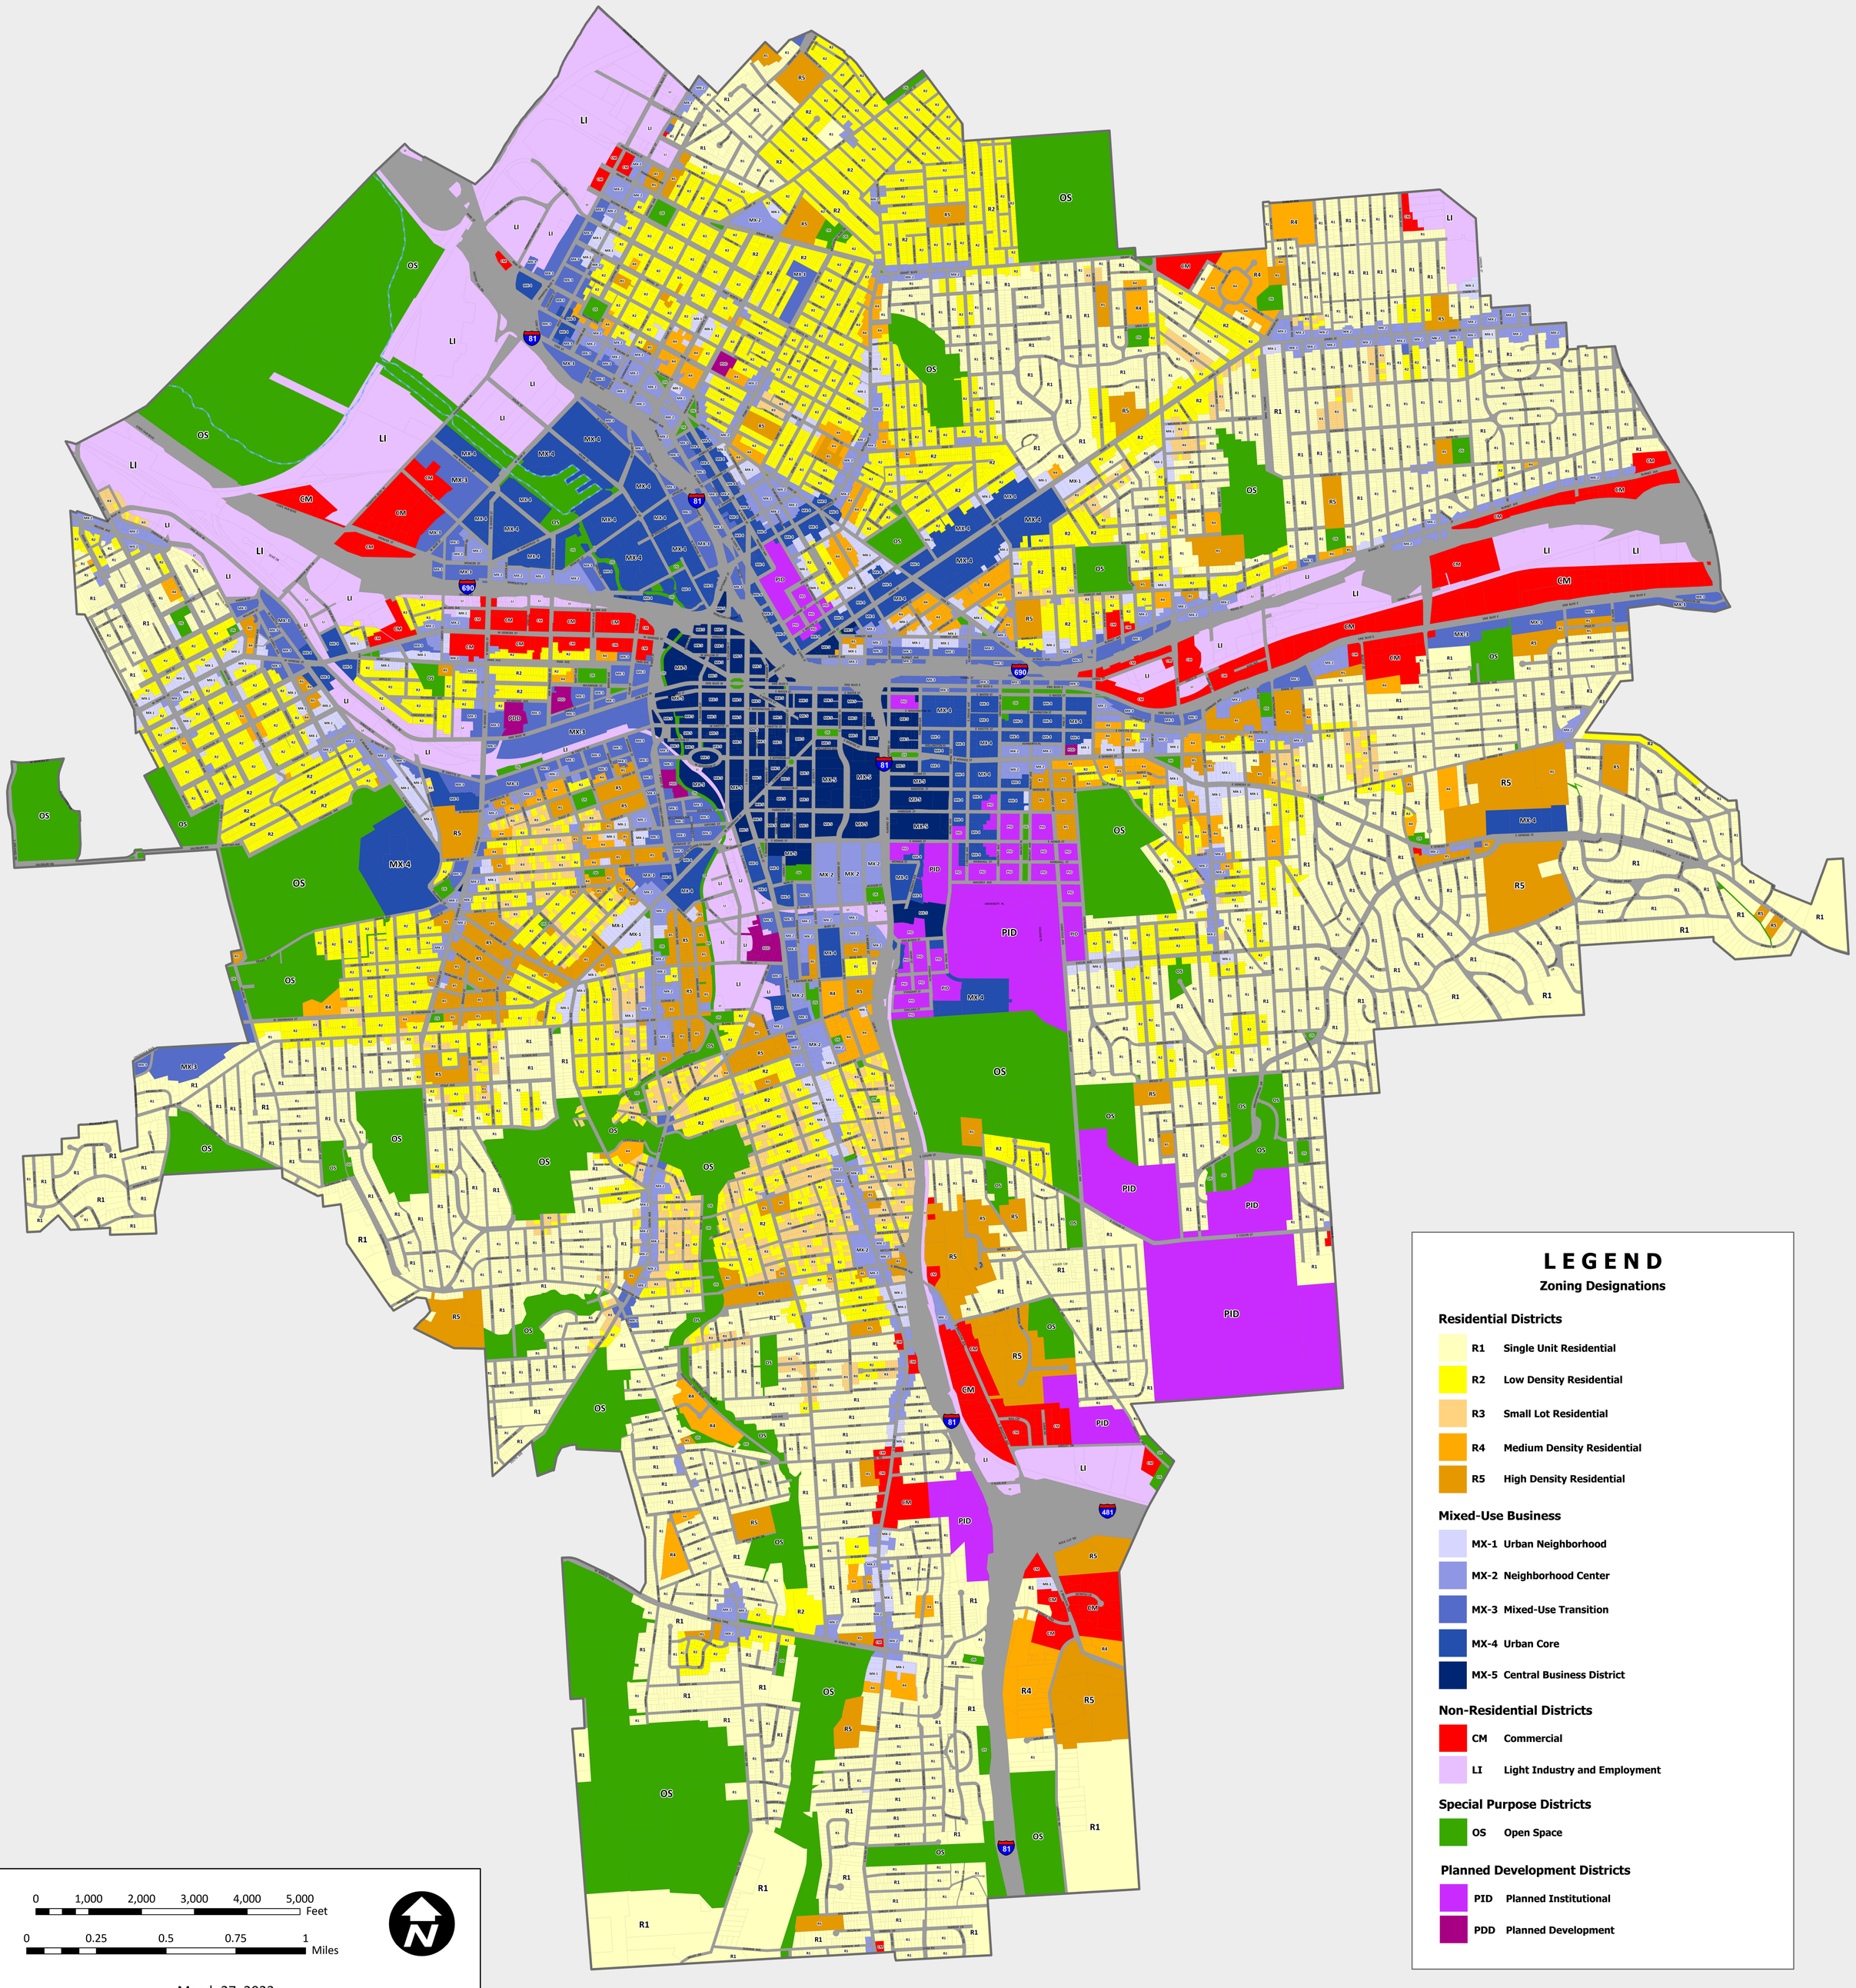

LEGEND

Zoning Designations

Residential Districts

- R1 Single Unit Residential
- R2 Low Density Residential
- R3 Small Lot Residential
- R4 Medium Density Residential
- R5 High Density Residential

Mixed-Use Business

- MX-1 Urban Neighborhood
- MX-2 Neighborhood Center
- MX-3 Mixed-Use Transition
- MX-4 Urban Core
- MX-5 Central Business District

Non-Residential Districts

- CM Commercial
- LI Light Industry and Employment

Special Purpose Districts

- OS Open Space

Planned Development Districts

- PID Planned Institutional
- PDD Planned Development

0 1,000 2,000 3,000 4,000 5,000 Feet

0 0.25 0.5 0.75 1 Miles

N

March 27, 2023

Onondaga County Sheriff's Office

Tobias Shelley
Sheriff

Jeffrey T. Passino
Undersheriff

Matthew Fischer	Chief Deputy Police Department
Nathan Hawker	Chief Deputy Custody Department
Craig Belcher	Chief Deputy Special Enforcement
John S. Drapikowski	Chief Deputy Correction Department
Lisa Dell	Chief Deputy Civil Department
Maureen Murphy	Chief Deputy Administration

Sheriff's Office	315-435-3044
Police Department	435-3036
Human Resources	435-1767
Civil Department	435-3060
Correction Department	435-5581
Custody Department	435-1717
Criminal Investigations	435-3081
Police Records	435-3010
Custody Records	435-1782

September 3, 2024

Langan Engineering and Environmental Services, P.C.
200 W Madison Street
Suite 1920
Chicago, IL 60606
ATTN Sarah Gardner

Re: Freedom of Information Request – 200 Chavez Terrace - Any information or copies of files regarding environmental conditions on the above property, such as environmental permits, notices of violations, spill/discharge incidents, storage or disposal of hazardous substances, Underground Storage Tanks (USTs), Leaking Underground Storage Tanks (LTANKs), asbestos abatement, and any other environmental reports

Dear Ms. Gardner:

Your request has been received and reviewed. The Onondaga County Sheriff's Office was unable to locate any records related to your request.

Sincerely,

MK

M. Kiggins

Records Access Officer

MK/

FR#24-0830-06

Appendix C Site Reconnaissance Checklist and Photographs

Appendix C Site Reconnaissance Checklist and Photographs

LANGAN

PHASE I ESA SITE RECONNAISSANCE CHECKLIST

GENERAL INFORMATION
Langan personnel: Nick Hodom
Date of site reconnaissance: 3 September 2024
Business name / subject property occupant: Chavez Terrace Residential Apartment Complex
Full subject property address: 200 – 224 Chavez Terrace, Syracuse, New York
Weather conditions: 70 degrees, sunny

Features, Activities, Uses, and Conditions	Identified/Observed?		Report Section(s)
General Subject Property Setting	**Yes**	**No**	
Current use(s) of the subject property	☒	☐	2.0
Past use(s) of the subject property	☐	☒	3.1
Current use(s) of adjoining properties	☒	☐	4.1
Past use(s) of adjoining properties	☐	☒	4.2
Current or past uses in the surrounding area	☒	☐	4.1 and 4.2
Geologic, hydrogeologic, hydrologic, and topographic conditions	☒	☐	2.2
Structures and other improvements at the subject property	☒	☐	2.3
Roads	☒	☐	2.3
Potable water supply/source for the subject property	☒	☐	2.4
Sewage disposal system for the subject property	☒	☐	2.4

Interior/Exterior Features	At Interior?		At Exterior?		Report Section(s) (if yes)
	Yes	**No**	**Yes**	**No**	
Hazardous substances and petroleum products in connection with identified uses	☒	☐	☐	☒	2.5
Storage tanks	☐	☒	☐	☒	2.5.1 and 2.5.2
Strong, pungent, or noxious odors and their sources	☐	☒	☐	☒	2.6
Standing surface water and pools or sumps containing liquids likely to be hazardous substances or petroleum products	☐	☒	☐	☒	2.5
Drums, totes, and intermediate bulk containers	☐	☒	☐	☒	2.5.3
Hazardous substance and petroleum product containers not in connection with identified uses	☐	☒	☐	☒	2.5.4
Unidentified substance containers	☐	☒	☐	☒	2.5.4
PCB-containing items	☐	☒	☒	☐	2.5.4
Heating/cooling	☒	☐	☒	☐	2.4
Stains or corrosion on floors, walls, or ceilings	☒	☐	☐	☒	2.5 and 2.7
Drains and sumps	☒	☐	☒	☐	2.8
Pits, ponds, or lagoons	☐	☒	☐	☒	2.2.3
Stained soil or pavement	☐	☒	☐	☒	2.5 and 2.7
Stressed vegetation	☐	☒	☐	☒	2.9
Solid waste	☒	☐	☒	☐	2.7
Water/wastewater	☐	☒	☐	☒	2.8 and 2.9
Wells	☐	☒	☐	☒	2.2.3
Septic systems or cesspools	☐	☒	☐	☒	2.8

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	200 – 224 Chavez Terrace, Syracuse, New York	170859701

Date	Photo No.
9/3/2024	1.

Direction Photo Taken:

South

Description:

View of the entrance to the subject property from South State Street.

Date	Photo No.
9/3/2024	2.

Direction Photo Taken:

East

Description:

View of the entrance to the subject property from South State Street.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	200 – 224 Chavez Terrace, Syracuse, New York	170859701

Date	Photo No.
9/3/2024	3.

Direction Photo Taken:

Northeast

Description:

View of 200 – 205 Chavez Terrace.

Date	Photo No.
9/3/2024	4.

Direction Photo Taken:

North

Description:

View of 206 – 207 Chavez Terrace.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	200 – 224 Chavez Terrace, Syracuse, New York	170859701

Date	Photo No.
9/3/2024	5.

Direction Photo Taken:

East

Description:

View of 208 – 211 Chavez Terrace.

Date	Photo No.
9/3/2024	6.

Direction Photo Taken:

Southeast

Description:

View of 212 – 215 Chavez Terrace.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	200 – 224 Chavez Terrace, Syracuse, New York	170859701

Date	Photo No.
9/3/2024	7.

Direction Photo Taken:

South

Description:

View of 216 – 218 Chavez Terrace

Date	Photo No.
9/3/2024	8.

Direction Photo Taken:

Southwest

Description:

View of 219 – 224 Chavez Terrace.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	200 – 224 Chavez Terrace, Syracuse, New York	170859701

Date	Photo No.
9/3/2024	9.

Direction Photo Taken:

North

Description:

View of an electrical transformer located between 200 – 204 Chavez Terrace and 206 – 207 Chavez Terrace. Non-PCB labeling was not observed.

Date	Photo No.
9/3/2024	10.

Direction Photo Taken:

East

Description:

View of pad-mounted electrical transformers located between 208 – 211 Chavez Terrace and 212 – 215 Chavez Terrace. Non-PCB labeling was not observed.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	200 – 224 Chavez Terrace, Syracuse, New York	170859701

Date	Photo No.
9/3/2024	11.

Direction Photo Taken:

East

Description:

View of pad-mounted electrical transformer located between 208 – 211 Chavez Terrace and 212 – 215 Chavez Terrace. Non-PCB labeling was not observed.

Date	Photo No.
9/3/2024	12.

Direction Photo Taken:

South

Description:

View of pad-mounted electrical Transformer located between 216 – 218 Chavez Terrace and 219 – 224 Chavez Terrace. Non-PCB labeling was not observed.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	200 – 224 Chavez Terrace, Syracuse, New York	170859701

Date	Photo No.
9/3/2024	13.

Direction Photo Taken:

South

Description:

View of pad-mounted electrical transformers located between on the southwestern exterior of 219 – 224 Chavez Terrace. Non-PCB labeling was not observed.

Date	Photo No.
9/3/2024	14.

Direction Photo Taken:

North

Description:

Representative view of electric and natural gas meters present on building exteriors.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	200 – 224 Chavez Terrace, Syracuse, New York	170859701

Date	Photo No.
9/3/2024	15.

Direction Photo Taken:

East

Description:

Representative view of apartment entrance from Chavez Terrace.

Date	Photo No.
9/3/2024	16.

Direction Photo Taken:

North

Description:

Representative view of apartment kitchen with a gas powered four burner stove and electric fridge/freezer.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	200 – 224 Chavez Terrace, Syracuse, New York	170859701

Date	Photo No.
9/3/2024	17.

Direction Photo Taken:

West

Description:

View of miscellaneous cleaning products observed beneath kitchen sink in apartment 211.

Date	Photo No.
9/3/2024	18.

Direction Photo Taken:

North

Description:

View of natural-gas fired 75,000-BTU Utica Boiler, model MGB7521 located within second floor utility closet within each apartment space.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	200 – 224 Chavez Terrace, Syracuse, New York	170859701

Date	Photo No.
9/3/2024	19.

Direction Photo Taken:

North

Description:

View of natural-gas fired Bradford White 40-Gallon hot water heater, model MI40356FBN.

Date	Photo No.
9/3/2024	20.

Direction Photo Taken:

South

Description:

Representative view of hot water radiant floorboard heaters located throughout apartment spaces.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	200 – 224 Chavez Terrace, Syracuse, New York	170859701

Date	Photo No.
9/3/2024	21.

Direction Photo Taken:

South

Description:

View of window mounted electric powered air conditioning unit observed throughout various bedrooms within apartment buildings.

Date	Photo No.
9/3/2024	22.

Direction Photo Taken:

West

Description:

Representative view of laundry room with plumbing and electric connections located within entryway foyer of apartment buildings.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	200 – 224 Chavez Terrace, Syracuse, New York	170859701

Date	Photo No.
9/3/2024	23.

Direction Photo Taken:

North

Description:

View of the southern-adjoining property - Latimer Terrace apartment complex (199-101 Latimer Terrace)

Date	Photo No.
9/3/2024	24.

Direction Photo Taken:

North

Description:

View of the northern-adjoining property - Angelou Terrace apartment complex (100-192 Angelou Terrace).

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	200 – 224 Chavez Terrace, Syracuse, New York	170859701

Date	Photo No.
9/3/2024	25.

Direction Photo Taken:

East

Description:

View of the eastern-adjoining property - Pioneer Homes apartment complex (911-939 South Townsend Street).

Date	Photo No.
9/3/2024	26.

Direction Photo Taken:

West

Description:

View of the western-adjoining property - Roesler Park.

Appendix D User Provided Information

User Questionnaire
Introduction/Limitations
November 2021

The information in this User Questionnaire is prepared and provided by the *user** to the environmental professional pursuant to 40 CFR 313.22 in order to qualify for one of the *Landowner Liability Protections* (LLPs) offered by the Small Business Liability Relief and Brownfields Revitalization Act of 2001 (the *"Brownfields Amendments"*). The user must conduct the following inquiries required by 40 C.F.R. §§ 312.25, 312.28, 312.29, 312.30, and 312.31. These inquiries must also be conducted by EPA Brownfield Assessment and Characterization grantees. The user should provide the following information to the environmental professional. Failure to conduct these inquiries could result in a determination that "all appropriate inquiries" is not complete.

*Pursuant to ASTM E 1527-21, the "user" is the party seeking to complete the environmental site assessment of the property. It is also the person seeking to establish one or more of the Landowner Liability Protections (LLPs) under CERCLA. A user may include, without limitation, a potential purchaser or potential leasee or tenant of the property, an owner of the property, a lender or a property manager.

DATE PREPARED: **8/29/24**

SUBJECT PROPERTY (address): **Phase Three Area, 301 - 311 E. Taylor Street, Syracuse NY**

USER(S): **MBSDI**

NAME OF PERSON COMPLETING QUESTIONNAIRE: **Mike Saunders**

(1) Environmental liens that are filed or recorded against the subject property (40 C.F.R. § 312.25).

Did a search of land title records (or judicial records where appropriate, see Note 1 below) identify any environmental liens filed or recorded against the subject property under federal, tribal, state, or local law?

NOTE 1—In certain jurisdictions, federal, tribal, state, or local statutes, or regulations specify that *environmental liens* and *AULs* be filed in judicial records rather than in *land title records*. In such cases judicial records shall be searched for *environmental liens* and *AULs*.

The Environmental Professional has performed the search for environmental cleanup liens and the results are included in the Phase I Report. Except as provided in the Phase I Report, the user has not identified any environmental cleanup liens.

(2) Activity and use limitations that are in place on the subject property or that have been filed or recorded against the subject property.

Did a search of land title records (or judicial records where appropriate, see Note 1 above) identify any AULs, such as engineering controls, land use restrictions or institutional controls that are in place at the subject property and/or have been filed or recorded against the subject property under federal, tribal, state or local law?

The Environmental Professional has performed the search for AULs and the results are included in the Phase I Report. Except as provided in the Phase I Report, the user has not identified any AULs for the subject property.

(3) Specialized knowledge or experience of the person seeking to qualify for the LLP (40 C.F.R. § 312.28).

Do you have any specialized knowledge or experience related to the subject property or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the subject property or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business?

The user is a developer of multifamily and mixed-use properties, and has provided to the Environmental Professional all specialized knowledge, if any, that it has in connection with the subject property or nearby properties relevant to environmental matters.

(4) Relationship of the lease price to the fair market value of the subject property if it were not contaminated (40 C.F.R. § 312.29).

Does the lease price being paid for this subject property reasonably reflect the fair market value of the property? If you conclude that there is a difference, have you considered whether the lower lease price is because contamination is known or believed to be present at the subject property?

In the opinion of the user, the lease price reasonably reflects the fair market value of the subject property, given the non-environmental use restrictions imposed as part of the lease. The user believes the purchase price reflects several factors, including the overall physical and economic conditions at and near the subject property and the seller's desire to encourage and incentivize redevelopment of the subject property for a public good. To the knowledge of the user, the lease price has not been adjusted to reflect any real or potential contamination that might be found at the subject property.

(5) Commonly known or reasonably ascertainable information about the subject property (40 C.F.R. § 312.30).

Are you aware of commonly known or reasonably ascertainable information about the subject property that would help the environmental professional to identify conditions indicative of releases or threatened releases? For example,

(a) Do you know the past uses of the subject property?

The user has provided to the Environmental Professional all relevant information/documents, if any, in its possession concerning former uses of the subject property.

(b) Do you know of specific chemicals that are present or once were present at the subject property?

The user has provided to the Environmental Professional all information/documents, if any, in its possession concerning specific chemicals that are present or once were present at the subject property.

(c) Do you know of spills or other chemical releases that have taken place at the subject property?

The user has provided to the Environmental Professional all information/documents, if any, in its possession concerning spills or other chemical releases at the subject property.

(d) Do you know of any environmental cleanups that have taken place at the subject property?

The user has provided to the Environmental Professional all information/documents, if any, in its possession concerning environmental cleanups that have taken place at the subject property.

(6) The degree of obviousness of the presence or likely presence of contamination at the subject property, and the ability to detect the contamination by appropriate investigation (40 C.F.R. § 312.31).

Based on your knowledge and experience related to the subject property, are there any obvious indicators that point to the presence or likely presence of releases at the subject property?

To the user's knowledge, the subject property has been used for various commercial and industrial purposes, but the user has not observed obvious indication of contamination at the subject property, other than information/documents that have been provided to the Environmental Professional.

Additional Questions:

(I) Helpful Documents

Do you know whether any of the environmental documents listed in Section 10.8.1 of ASTM E1527-21 exist? If so, can copies be provided to the environmental professional?

The user has provided to the Environmental Professional all information/documents, if any, in its possession relevant to environmental evaluations conducted at or for the subject property.

(II) Proceedings Involving the Subject Property Questions

Do you know of:

(1) Any pending, threatened, or past litigation relevant to hazardous substances or petroleum products in, on, at, or from the subject property?

The user has provided to the Environmental Professional all information/documents, if any, in its possession concerning pending, threatened, or past litigation relevant to hazardous substances and/or petroleum products in, on, at or from the subject property.

(2) Any pending, threatened, or past administrative proceedings relevant to hazardous substances or petroleum products in, on, at, or from the subject property?

The user has provided to the Environmental Professional all information/documents, if any, in its possession concerning pending, threatened, or past administrative proceedings relevant to hazardous substances and/or petroleum products in, on, at or from the subject property.

(3) Any notices from any governmental entity regarding any possible violation of environmental laws or possible liability relating to hazardous substances or petroleum products?

The user has provided to the Environmental Professional all information/documents, if any, in its possession concerning any possible violation of environmental laws or possible liability related to hazardous substances and/or petroleum products with respect to the subject property.

Appendix E Historical Resources

Appendix E Historical Resources

East Adams Redevelopment Phase Three Area

200 Chavez Terrace

Syracuse, NY 13202

Inquiry Number: 7748282.11

August 28, 2024

The EDR Aerial Photo Decade Package

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

EDR Aerial Photo Decade Package

08/28/24

Site Name:

East Adams Redevelopment P
200 Chavez Terrace
Syracuse, NY 13202
EDR Inquiry # 7748282.11

Client Name:

Langan Engineering, Inc.
360 W. 31st Street
New York, NY 10001
Contact: Sarah Gardner

Environmental Data Resources, Inc. (EDR) Aerial Photo Decade Package is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's professional researchers provide digitally reproduced historical aerial photographs, and when available, provide one photo per decade.

Search Results:

Year	Scale	Details	Source
2019	1"=500'	Flight Year: 2019	USDA/NAIP
2015	1"=500'	Flight Year: 2015	USDA/NAIP
2011	1"=500'	Flight Year: 2011	USDA/NAIP
2008	1"=500'	Flight Year: 2008	USDA/NAIP
1995	1"=500'	Acquisition Date: March 27, 1995	USGS/DOQQ
1988	1"=500'	Flight Date: October 31, 1988	NYDOT
1986	1"=500'	Flight Date: April 14, 1986	USDA
1978	1"=500'	Flight Date: September 13, 1978	USDA
1966	1"=500'	Flight Date: July 01, 1966	USDA
1959	1"=500'	Flight Date: June 15, 1959	USDA
1951	1"=500'	Flight Date: October 15, 1951	USDA
1938	1"=500'	Flight Date: September 05, 1938	USDA

When delivered electronically by EDR, the aerial photo images included with this report are for ONE TIME USE ONLY. Further reproduction of these aerial photo images is prohibited without permission from EDR. For more information contact your EDR Account Executive.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT.

Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2024 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

INQUIRY #: 7748282.11

YEAR: 2019

= 500'

N

EDR

INQUIRY #: 7748282.11

YEAR: 2015

= 500'

N

EDR

INQUIRY #: 7748282.11

YEAR: 2011

= 500'

N

EDR

INQUIRY #: 7748282.11

YEAR: 2008

= 500'

N

EDR

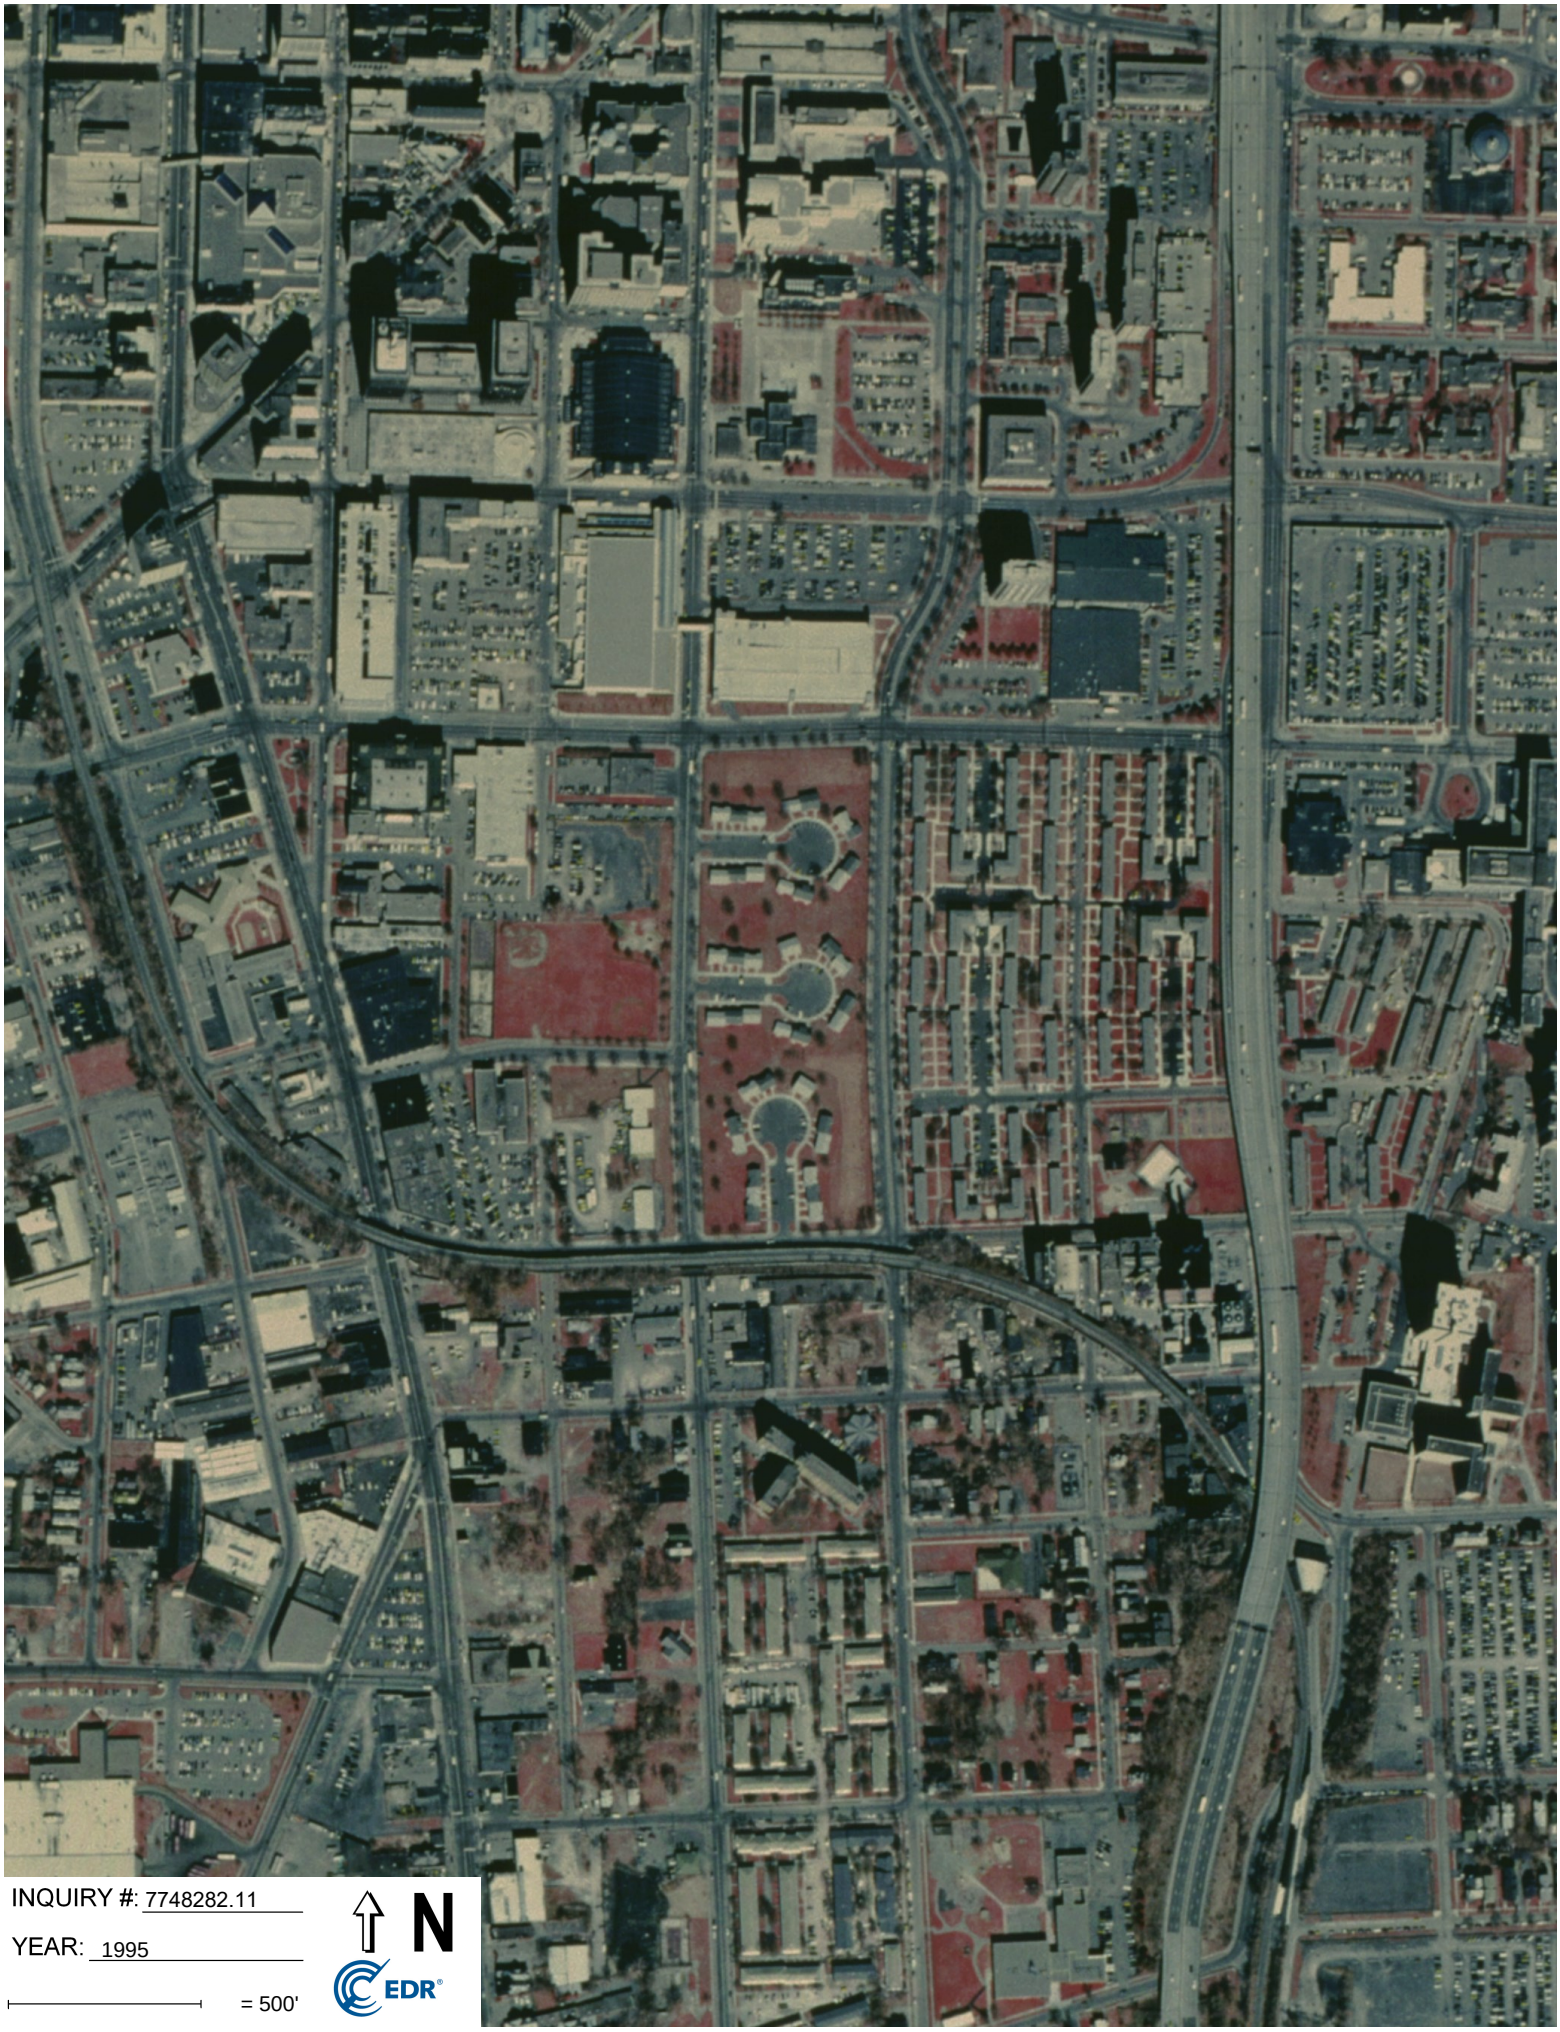

INQUIRY #: 7748282.11

YEAR: 1995

= 500'

N

EDR

INQUIRY #: 7748282.11

YEAR: 1988

= 500'

N

EDR

INQUIRY #: 7748282.11

YEAR: 1986

= 500'

N

EDR

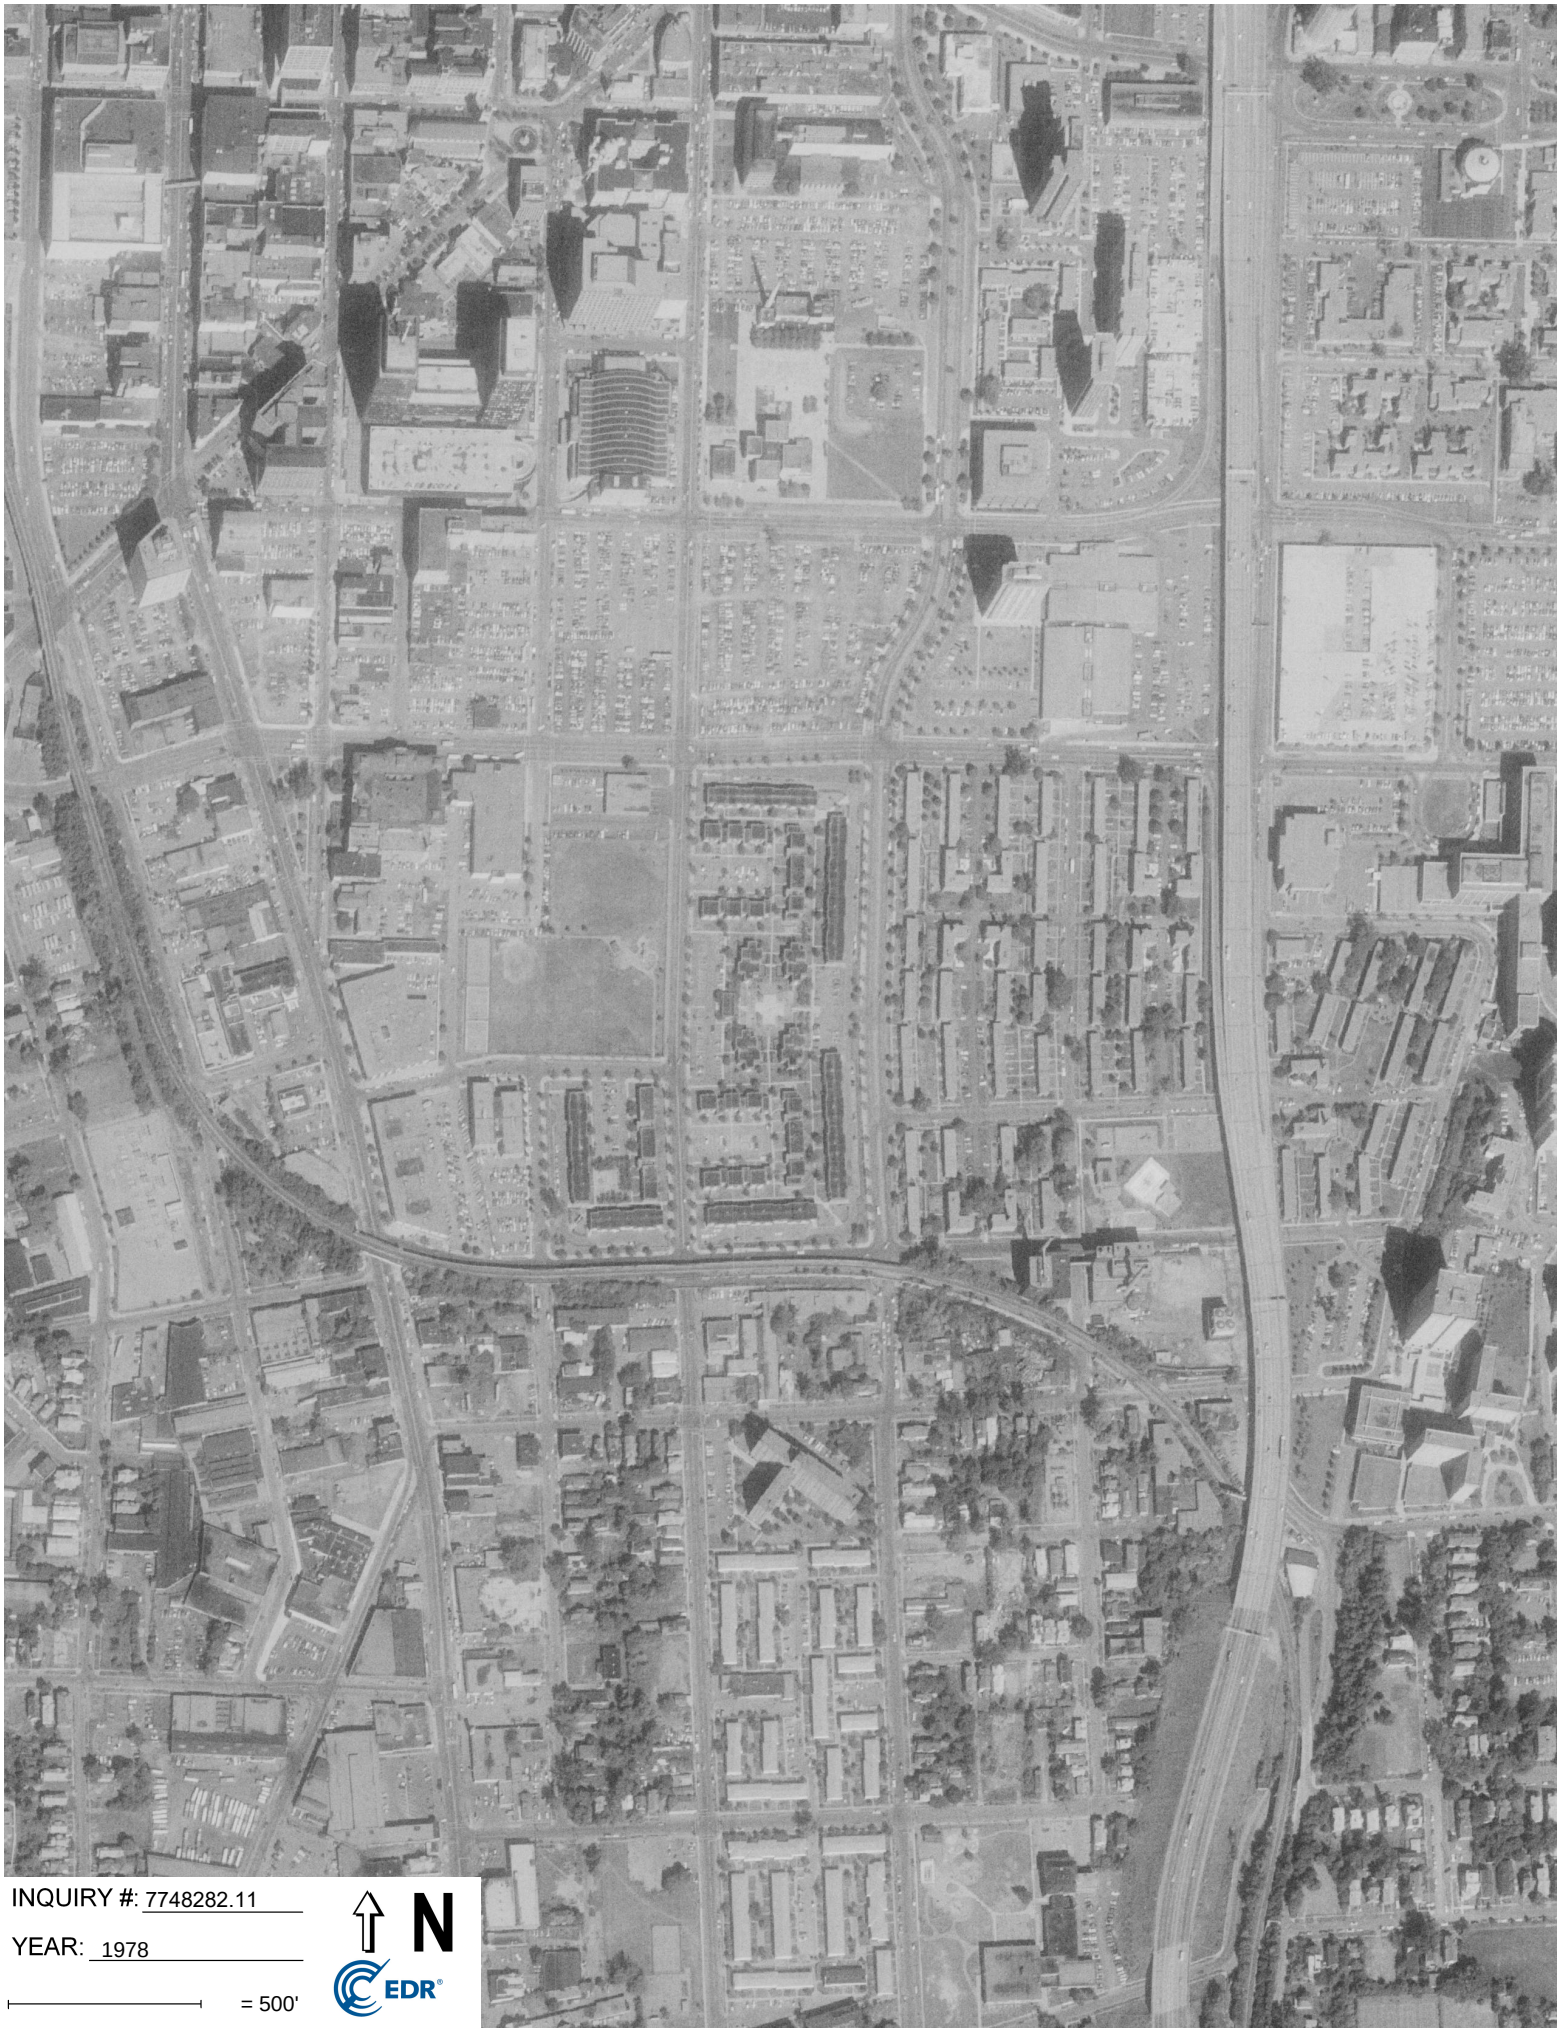

INQUIRY #: 7748282.11

YEAR: 1978

= 500'

N

EDR

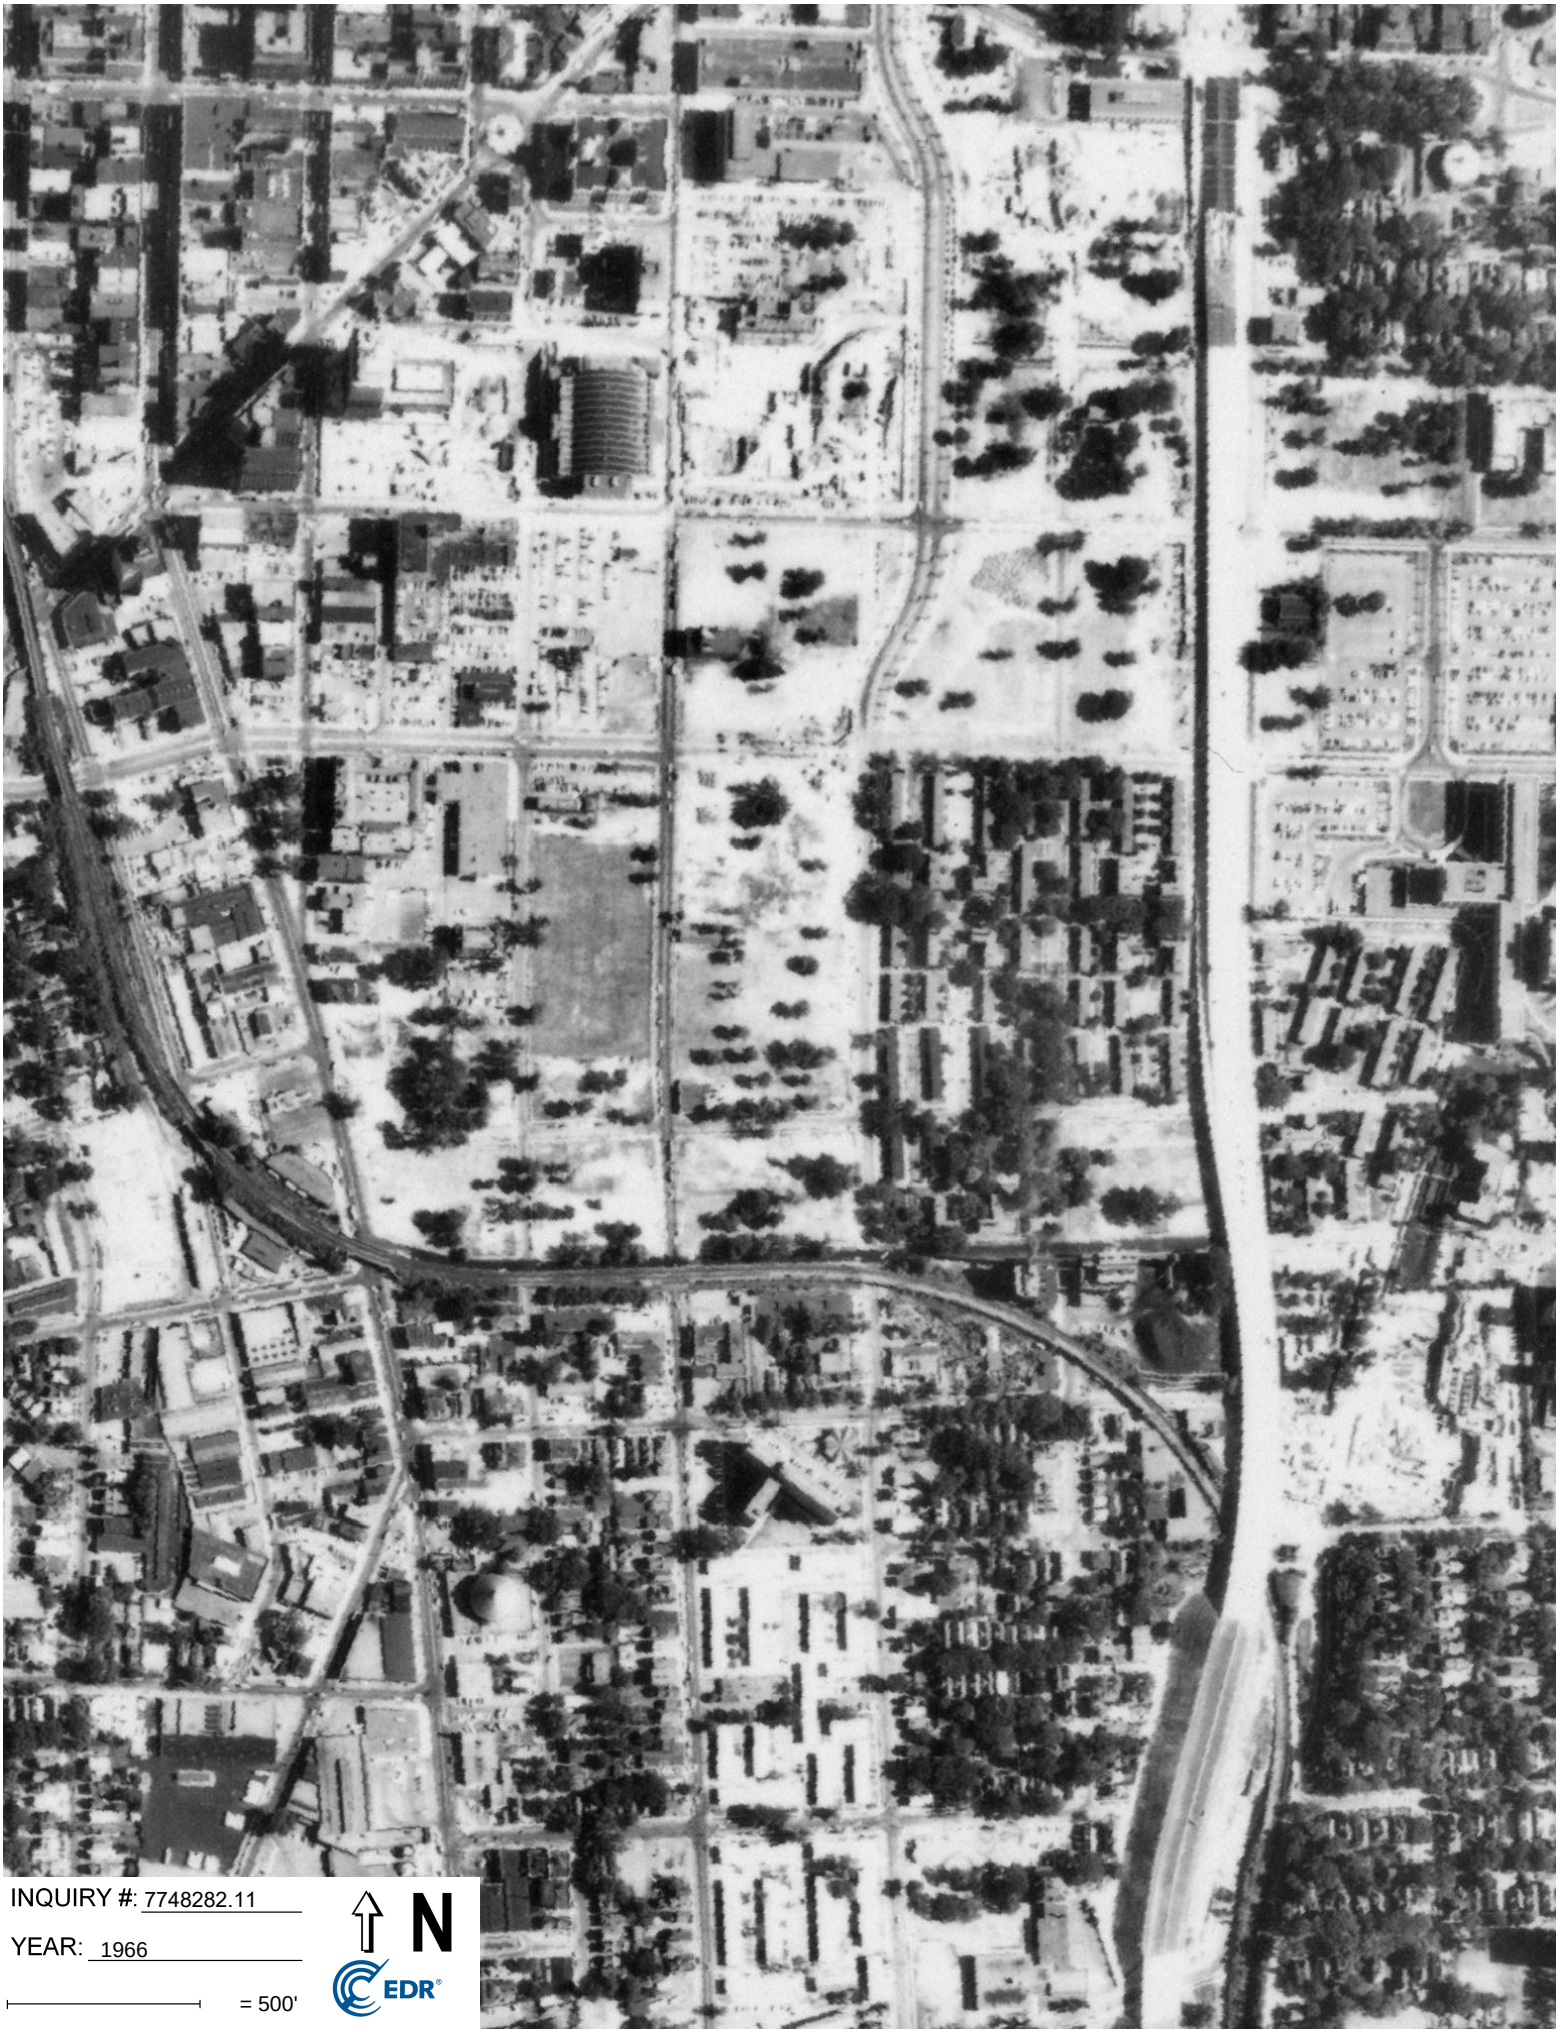

INQUIRY #: 7748282.11

YEAR: 1966

= 500'

N

EDR

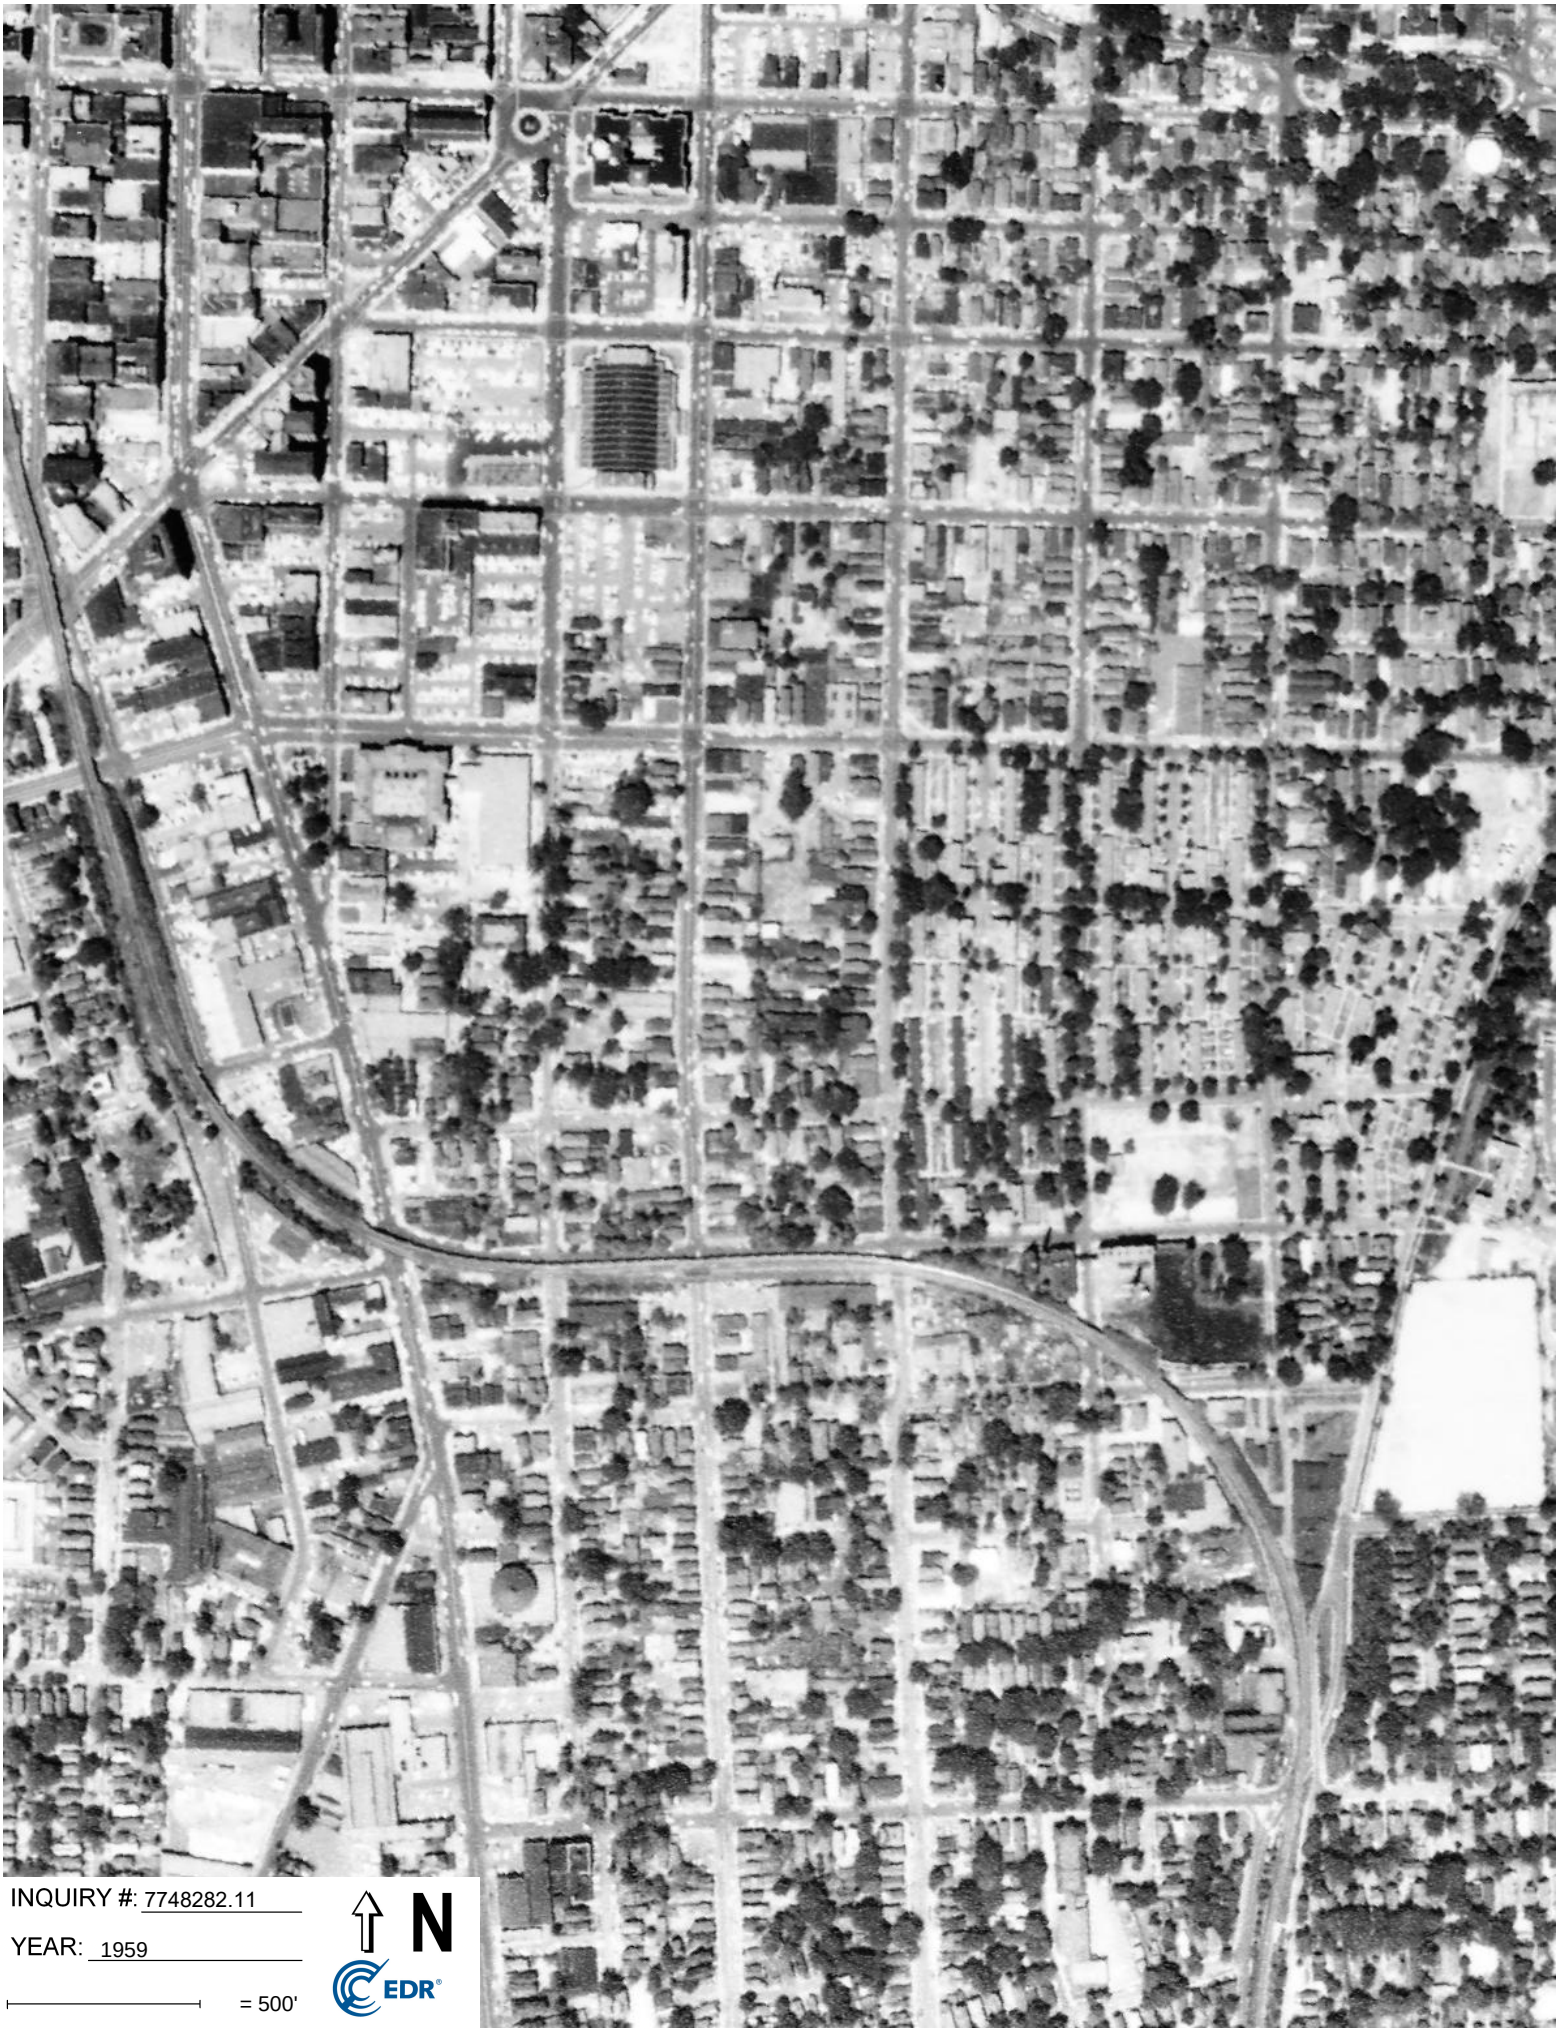
INQUIRY #: 7748282.11
YEAR: 1959
= 500'
N
EDR

INQUIRY #: 7748282.11

YEAR: 1951

= 500'

N

EDR

INQUIRY #: 7748282.11

YEAR: 1938

= 500'

N

EDR

East Adams Redevelopment Phase Three Area

200 Chavez Terrace

Syracuse, NY 13202

Inquiry Number: 7748282.4

August 28, 2024

EDR Historical Topo Map Report

with QuadMatch™

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

EDR Historical Topo Map Report

08/28/24

Site Name:

East Adams Redevelopment P
200 Chavez Terrace
Syracuse, NY 13202
EDR Inquiry # 7748282.4

Client Name:

Langan Engineering, Inc.
360 W. 31st Street
New York, NY 10001
Contact: Sarah Gardner

EDR Topographic Map Library has been searched by EDR and maps covering the target property location as provided by Langan Engineering, Inc. were identified for the years listed below. EDR's Historical Topo Map Report is designed to assist professionals in evaluating potential liability on a target property resulting from past activities. EDRs Historical Topo Map Report includes a search of a collection of public and private color historical topographic maps, dating back to the late 1800s.

Search Results:

P.O.# 170784004

Project: East Adams Redevelopment P

Coordinates:

Latitude:	43.040957 43° 2' 27" North
Longitude:	-76.146874 -76° 8' 49" West
UTM Zone:	Zone 18 North
UTM X Meters:	406581.87
UTM Y Meters:	4766001.19
Elevation:	398.00' above sea level

Maps Provided:

2019	1938, 1939
2016	1898
2013	1895
1978	
1973, 1977	
1957, 1958	
1947	
1939, 1943	

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT. Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2024 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

Topo Sheet Key

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

2019 Source Sheets

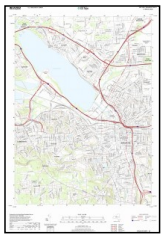

Syracuse West
2019
7.5-minute, 24000

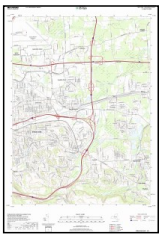

Syracuse East
2019
7.5-minute, 24000

2016 Source Sheets

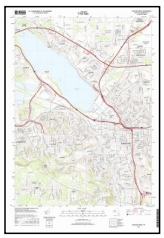

Syracuse West
2016
7.5-minute, 24000

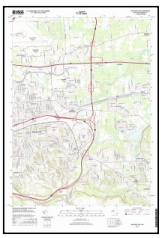

Syracuse East
2016
7.5-minute, 24000

2013 Source Sheets

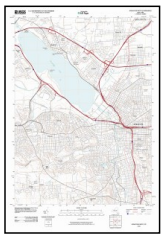

Syracuse West
2013
7.5-minute, 24000

Syracuse East
2013
7.5-minute, 24000

1978 Source Sheets

Syracuse East
1978
7.5-minute, 24000
Aerial Photo Revised 1976

Syracuse West
1978
7.5-minute, 24000
Aerial Photo Revised 1976

Topo Sheet Key

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

1973, 1977 Source Sheets

Syracuse West
1973
7.5-minute, 24000
Aerial Photo Revised 1972

Syracuse East
1977
7.5-minute, 24000
Aerial Photo Revised 1972

1957, 1958 Source Sheets

Syracuse East
1957
7.5-minute, 24000
Aerial Photo Revised 1956

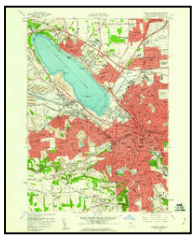

Syracuse West
1958
7.5-minute, 24000
Aerial Photo Revised 1956

1947 Source Sheets

Syracuse West
1947
7.5-minute, 31680

1939, 1943 Source Sheets

Syracuse West
1939
7.5-minute, 31680

Syracuse East
1943
7.5-minute, 31680

Topo Sheet Key

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

1938, 1939 Source Sheets

Syracuse East
1938
7.5-minute, 24000

1898 Source Sheets

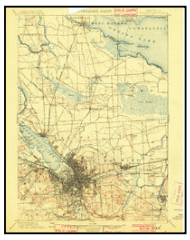

Syracuse
1898
15-minute, 62500

1895 Source Sheets

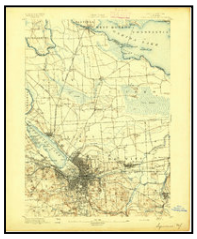

Syracuse
1895
15-minute, 62500

Historical Topo Map

2019

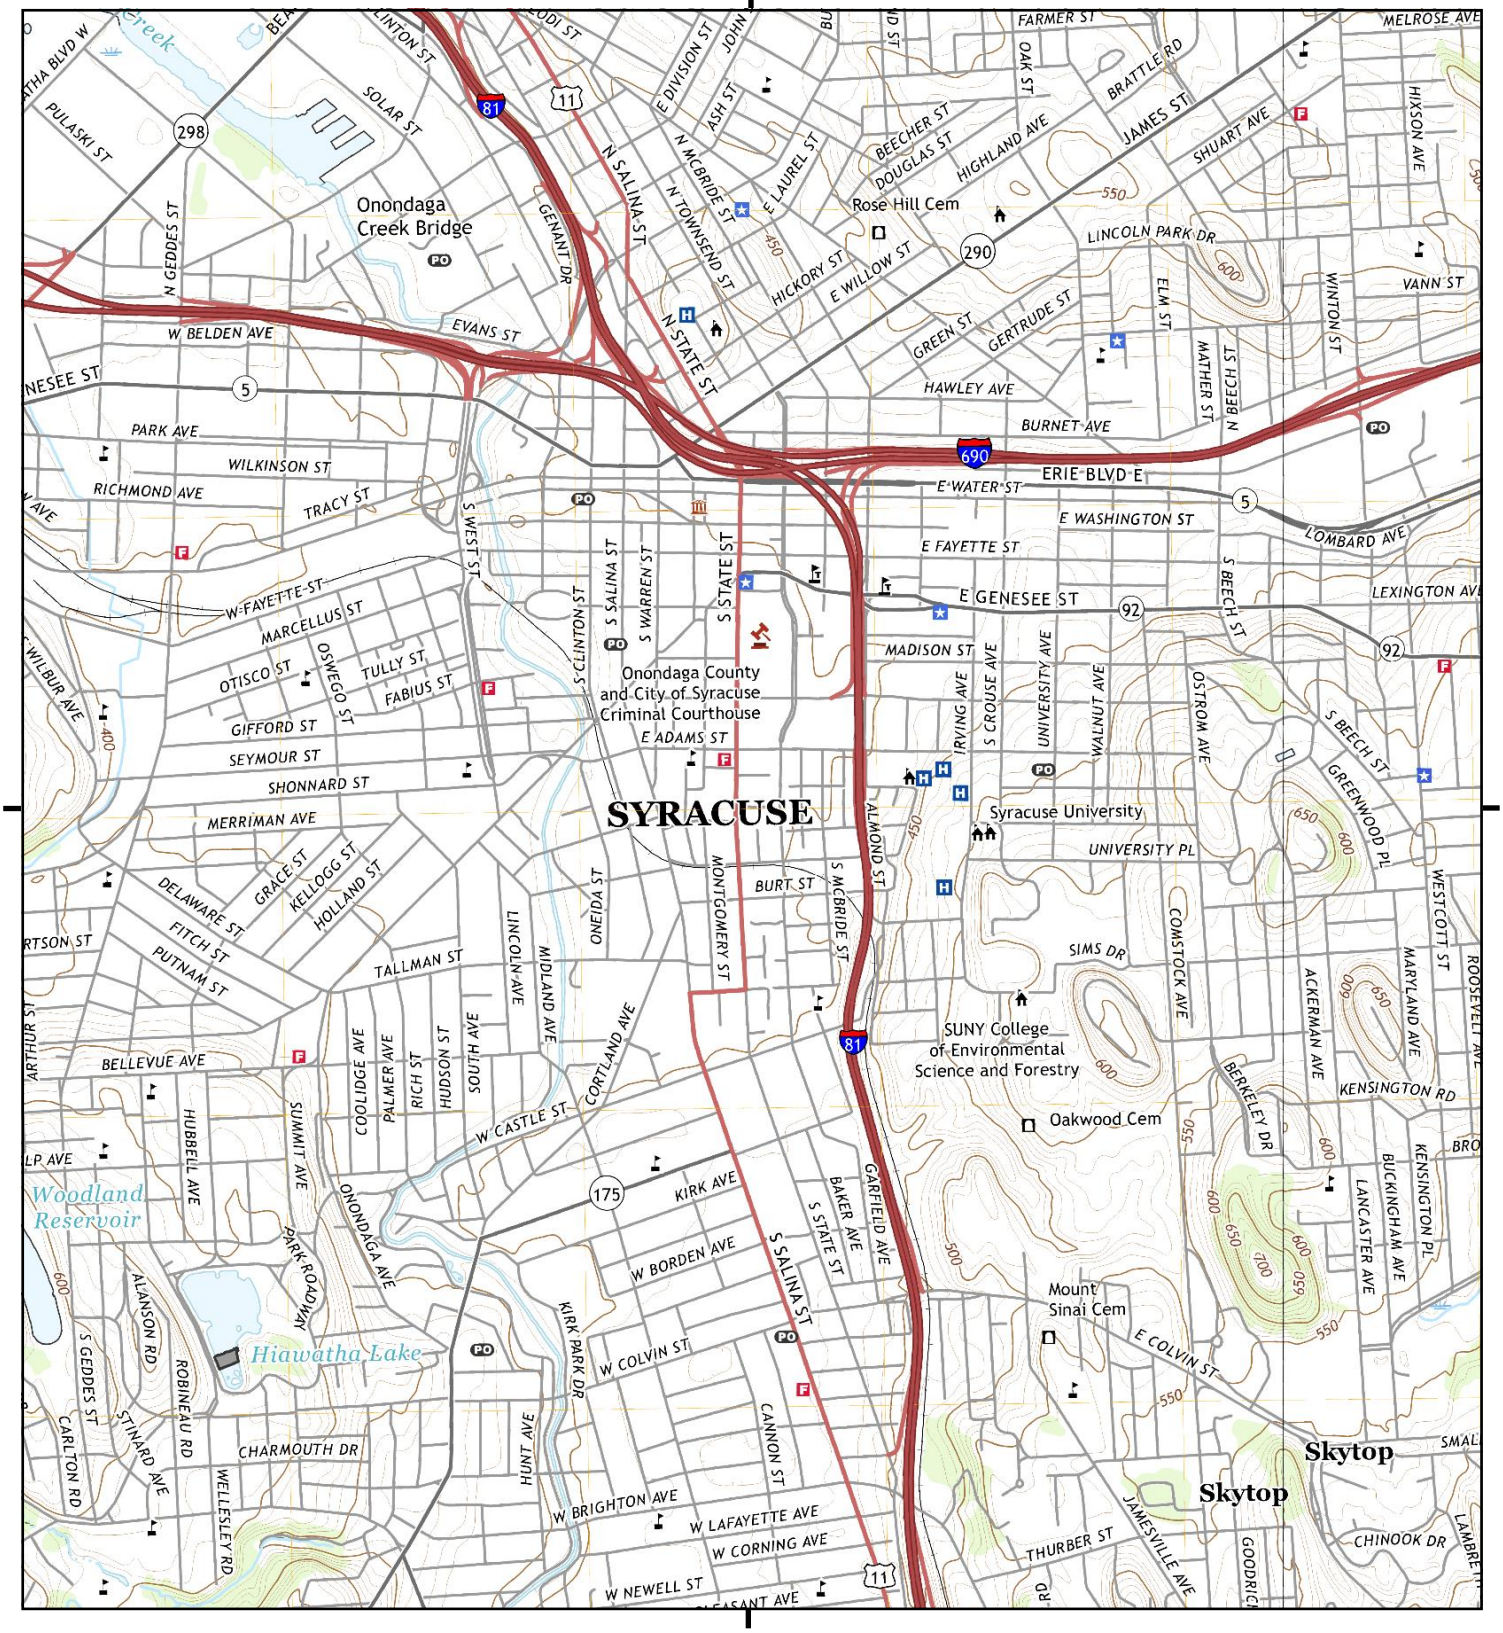

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Syracuse West, 2019, 7.5-minute
E, Syracuse East, 2019, 7.5-minute

SITE NAME: East Adams Redevelopment Phase Three
ADDRESS: 200 Chavez Terrace
Syracuse, NY 13202
CLIENT: Langan Engineering, Inc.

N

Historical Topo Map

2016

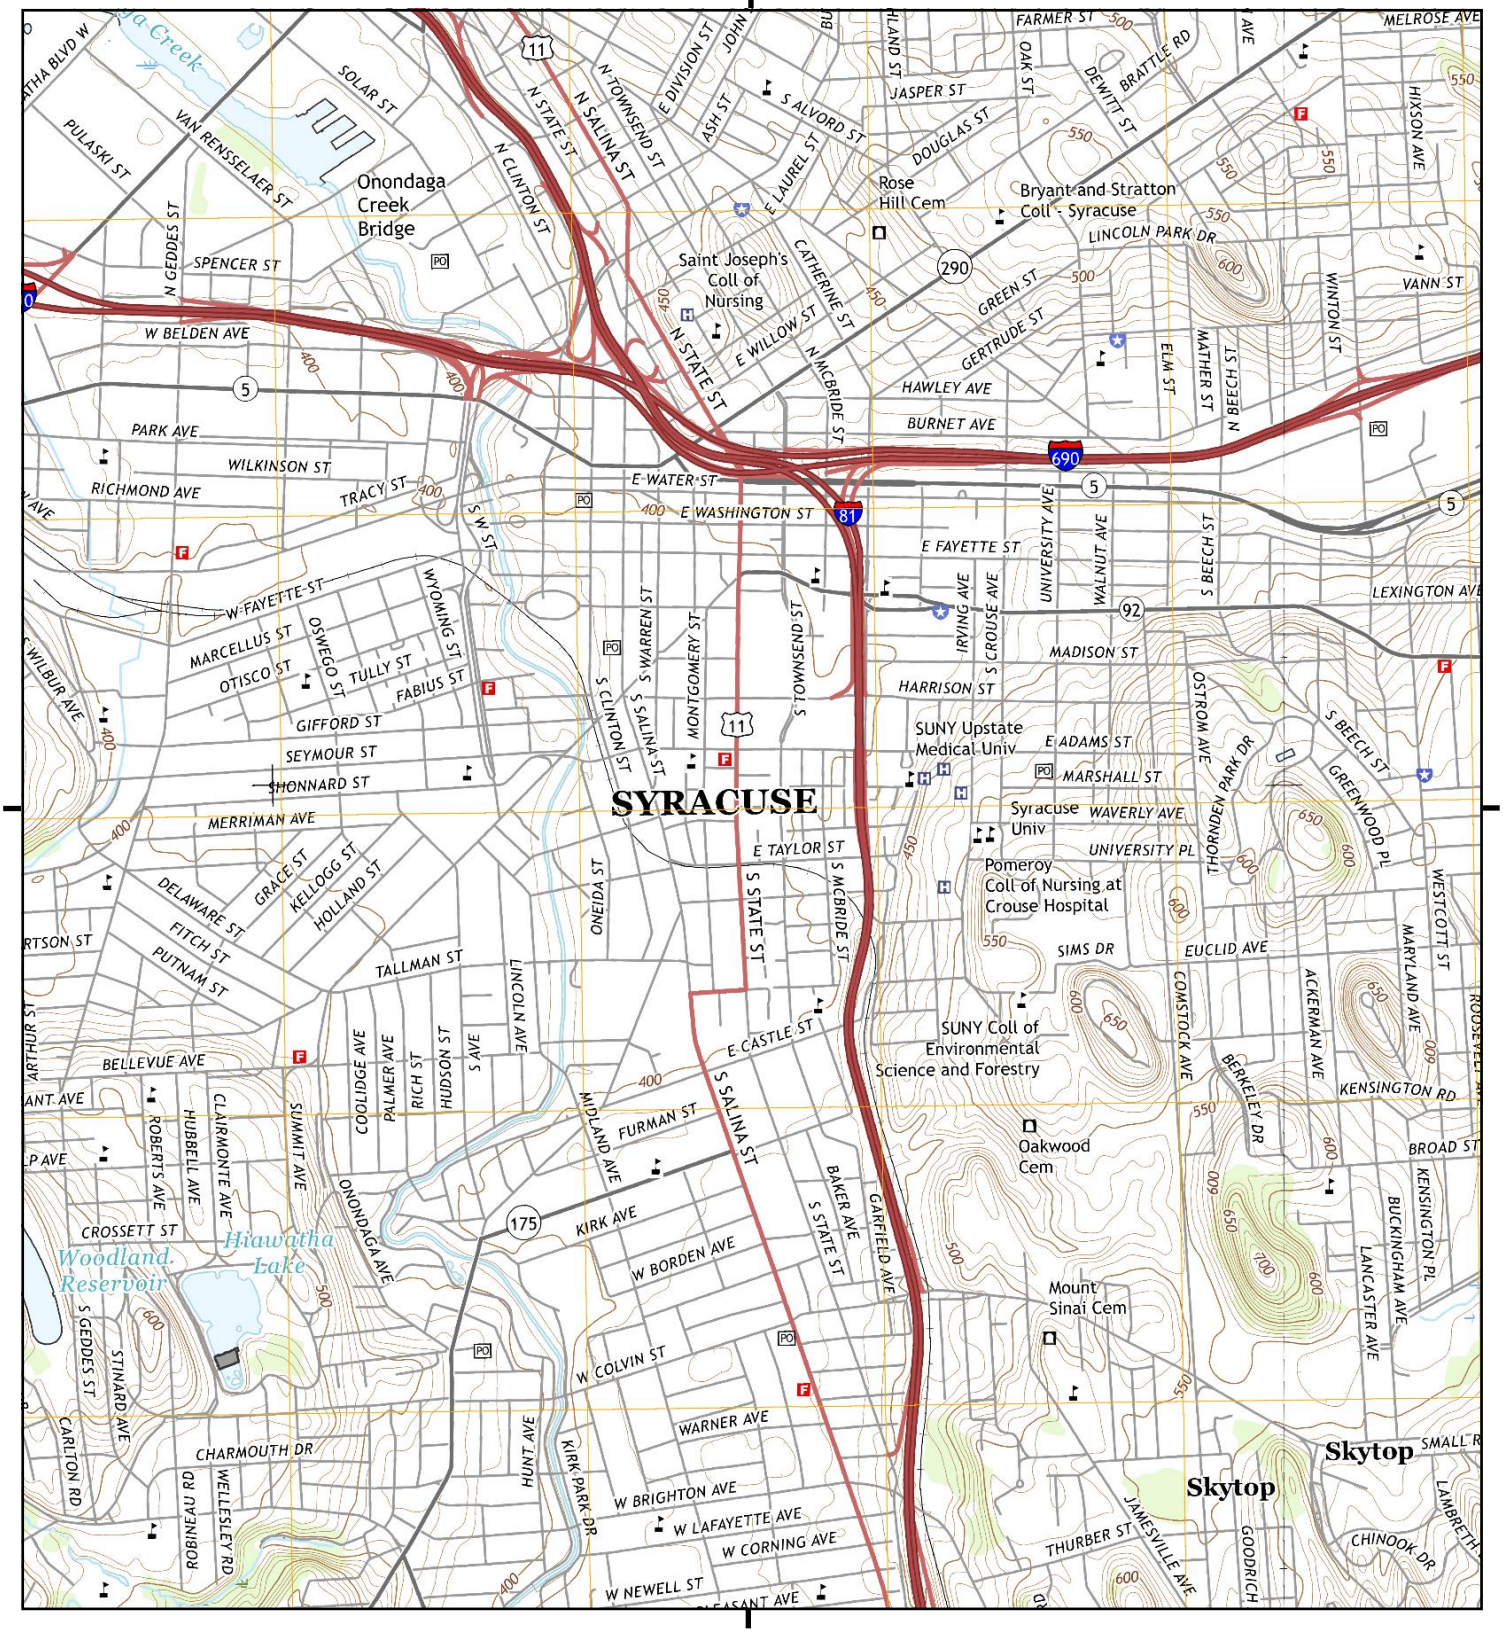

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Syracuse West, 2016, 7.5-minute
E, Syracuse East, 2016, 7.5-minute

SITE NAME: East Adams Redevelopment Phase Three
ADDRESS: 200 Chavez Terrace
Syracuse, NY 13202
CLIENT: Langan Engineering, Inc.

N

Historical Topo Map

2013

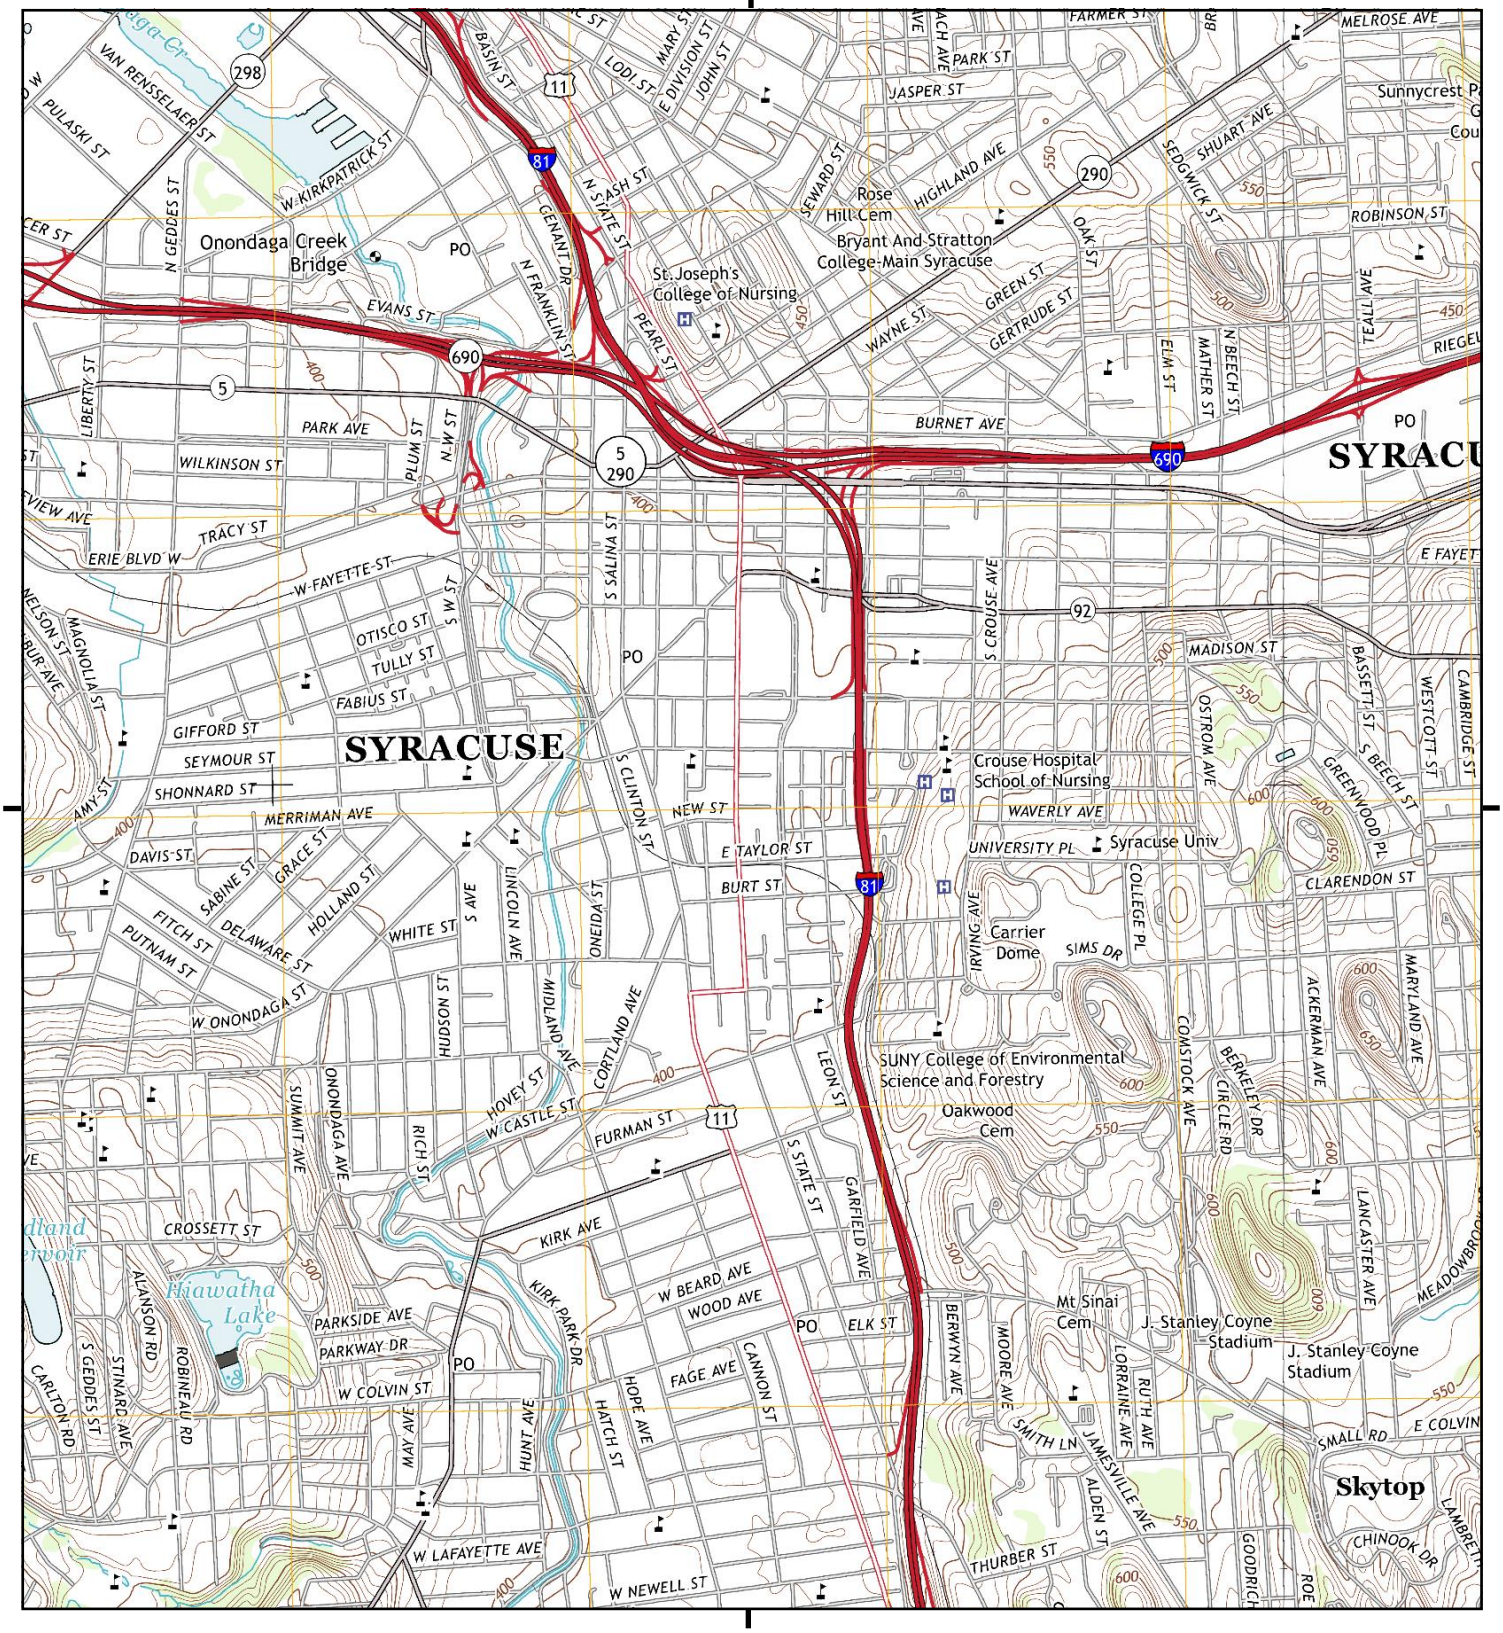

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Syracuse West, 2013, 7.5-minute
E, Syracuse East, 2013, 7.5-minute

SITE NAME: East Adams Redevelopment Phase Three
ADDRESS: 200 Chavez Terrace
Syracuse, NY 13202
CLIENT: Langan Engineering, Inc.

N

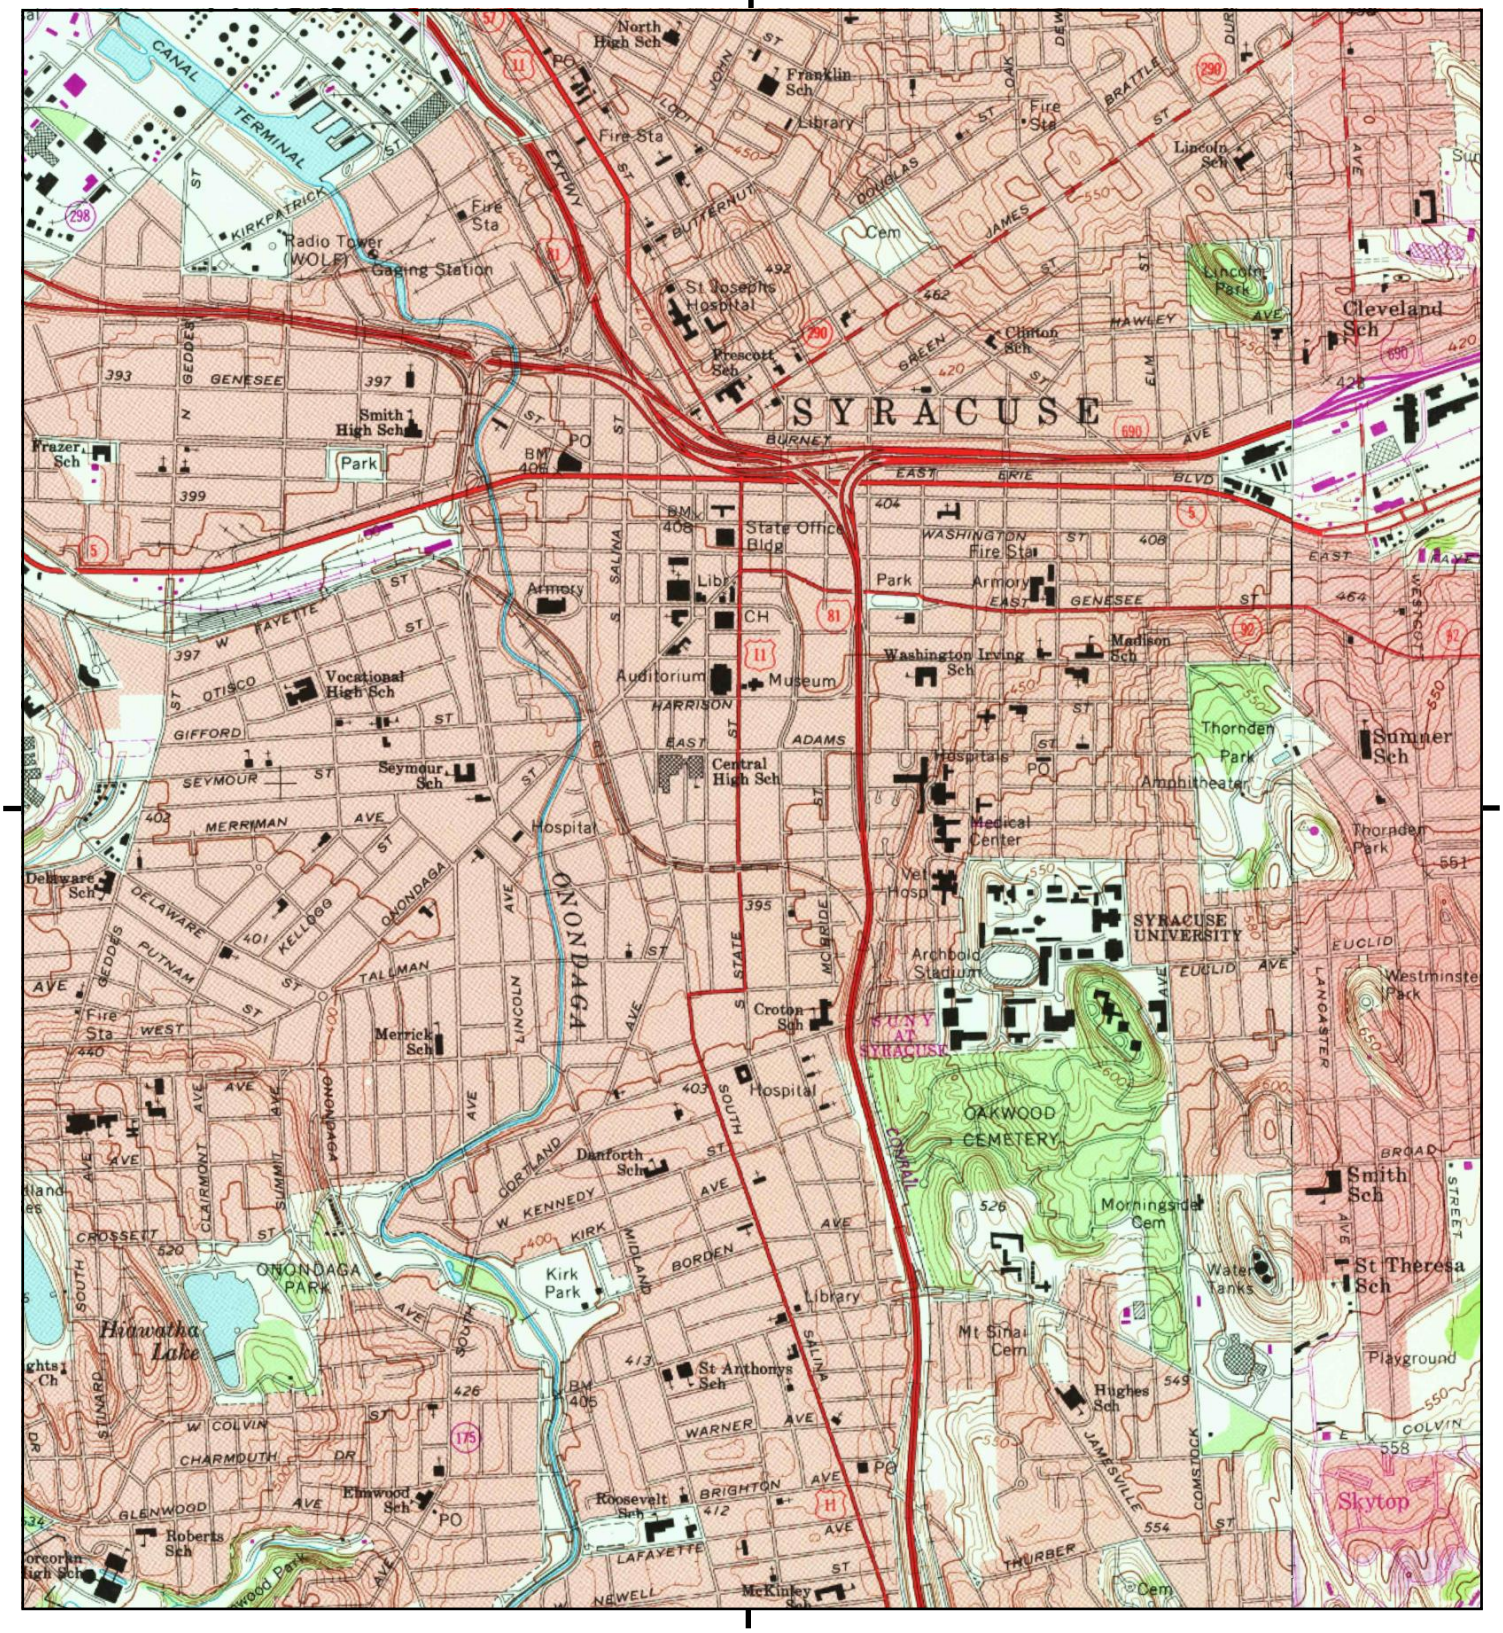

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

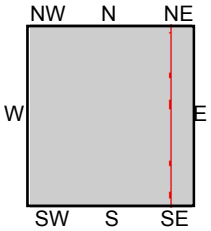

TP, Syracuse West, 1978, 7.5-minute
E, Syracuse East, 1978, 7.5-minute

SITE NAME: East Adams Redevelopment Phase Three
ADDRESS: 200 Chavez Terrace
Syracuse, NY 13202
CLIENT: Langan Engineering, Inc.

N

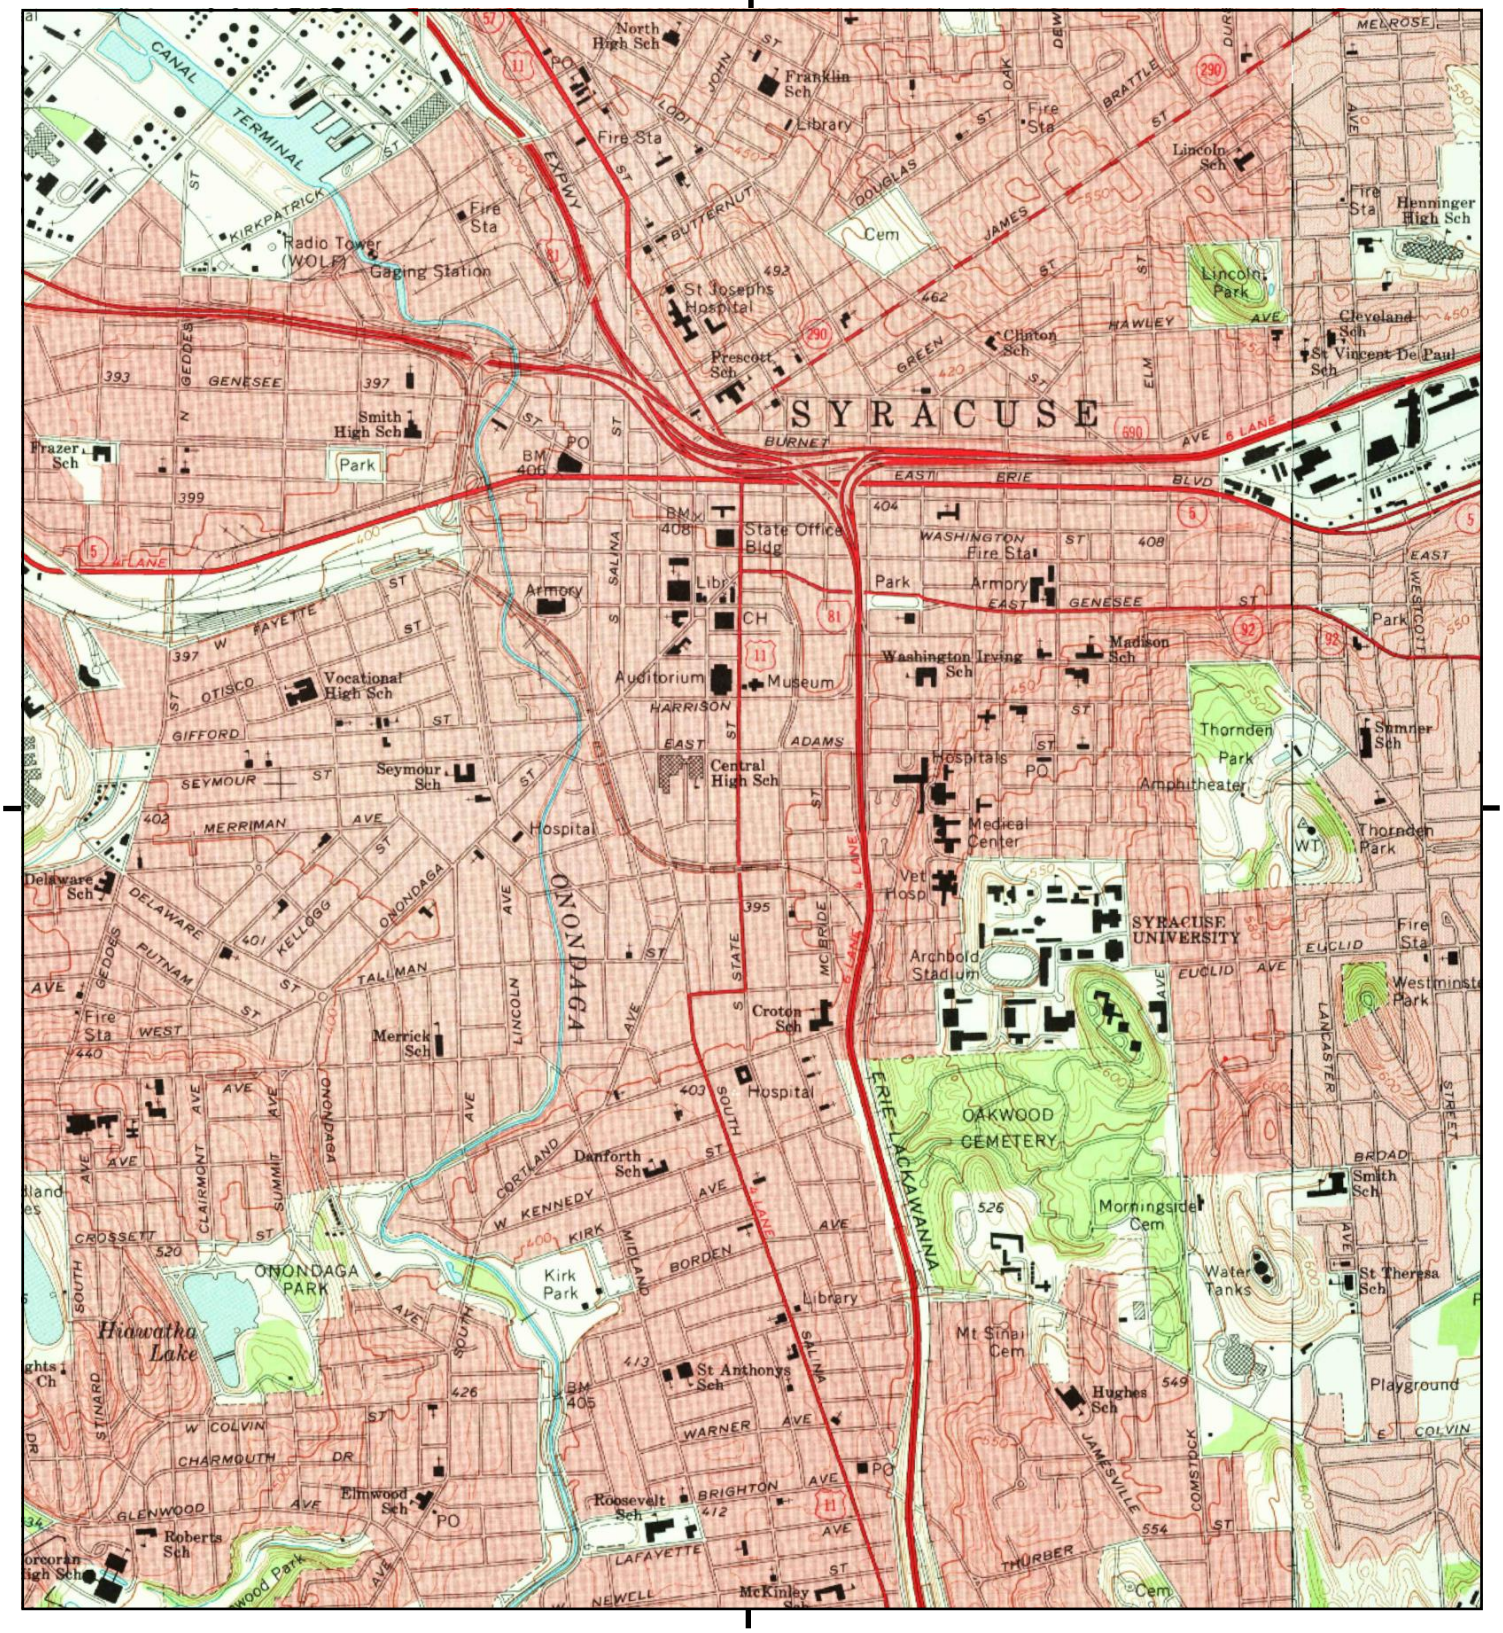
SYRACUSE
ONONDAGA
ONONDAGA PARK
Hiawatha Lake
OAKWOOD CEMETERY
SYRACUSE UNIVERSITY
ERIE-LACKAWANNA
CANAL TERMINAL
Fire Sta
Library
Park
Armory
Hospital
Hospitals
Medical Center
Amphitheater
Auditorium
Museum
Cem
Gaging Station
Radio Tower (WOLF)
North High Sch
Franklin Sch
Lincoln Sch
Henninger High Sch
Lincoln Park
Cleveland Sch
St Vincent De Paul Sch
St Josephs Hospital
Prescott Sch
Clinton Sch
Smith High Sch
Frazer Sch
State Office Bldg
Vocational High Sch
Central High Sch
Seymour Sch
Delaware Sch
Merrick Sch
Croton Sch
Danforth Sch
Kirk Park
St Anthonys Sch
Roosevelt Sch
Elmwood Sch
Roberts Sch
Washington Irving Sch
Madison Sch
Thornden Park
Summer Sch
Vet Hosp
Archbold Stadium
Westminster Park
Smith Sch
Morningside Cem
Water Tanks
St Theresa Sch
Mt Sinai Cem
Hughes Sch
Playground
Danforth Sch
Fire Sta
Water Tanks
Cem
Mc Kinley Sch
Roberts Sch
Elmwood Sch
Roosevelt Sch
St Anthonys Sch
Kirk Park
Merrick Sch
Croton Sch
Seymour Sch
Central High Sch
Vocational High Sch
Smith High Sch
Frazer Sch
Delaware Sch
Armory
Park
Fire Sta
Library
Hospital

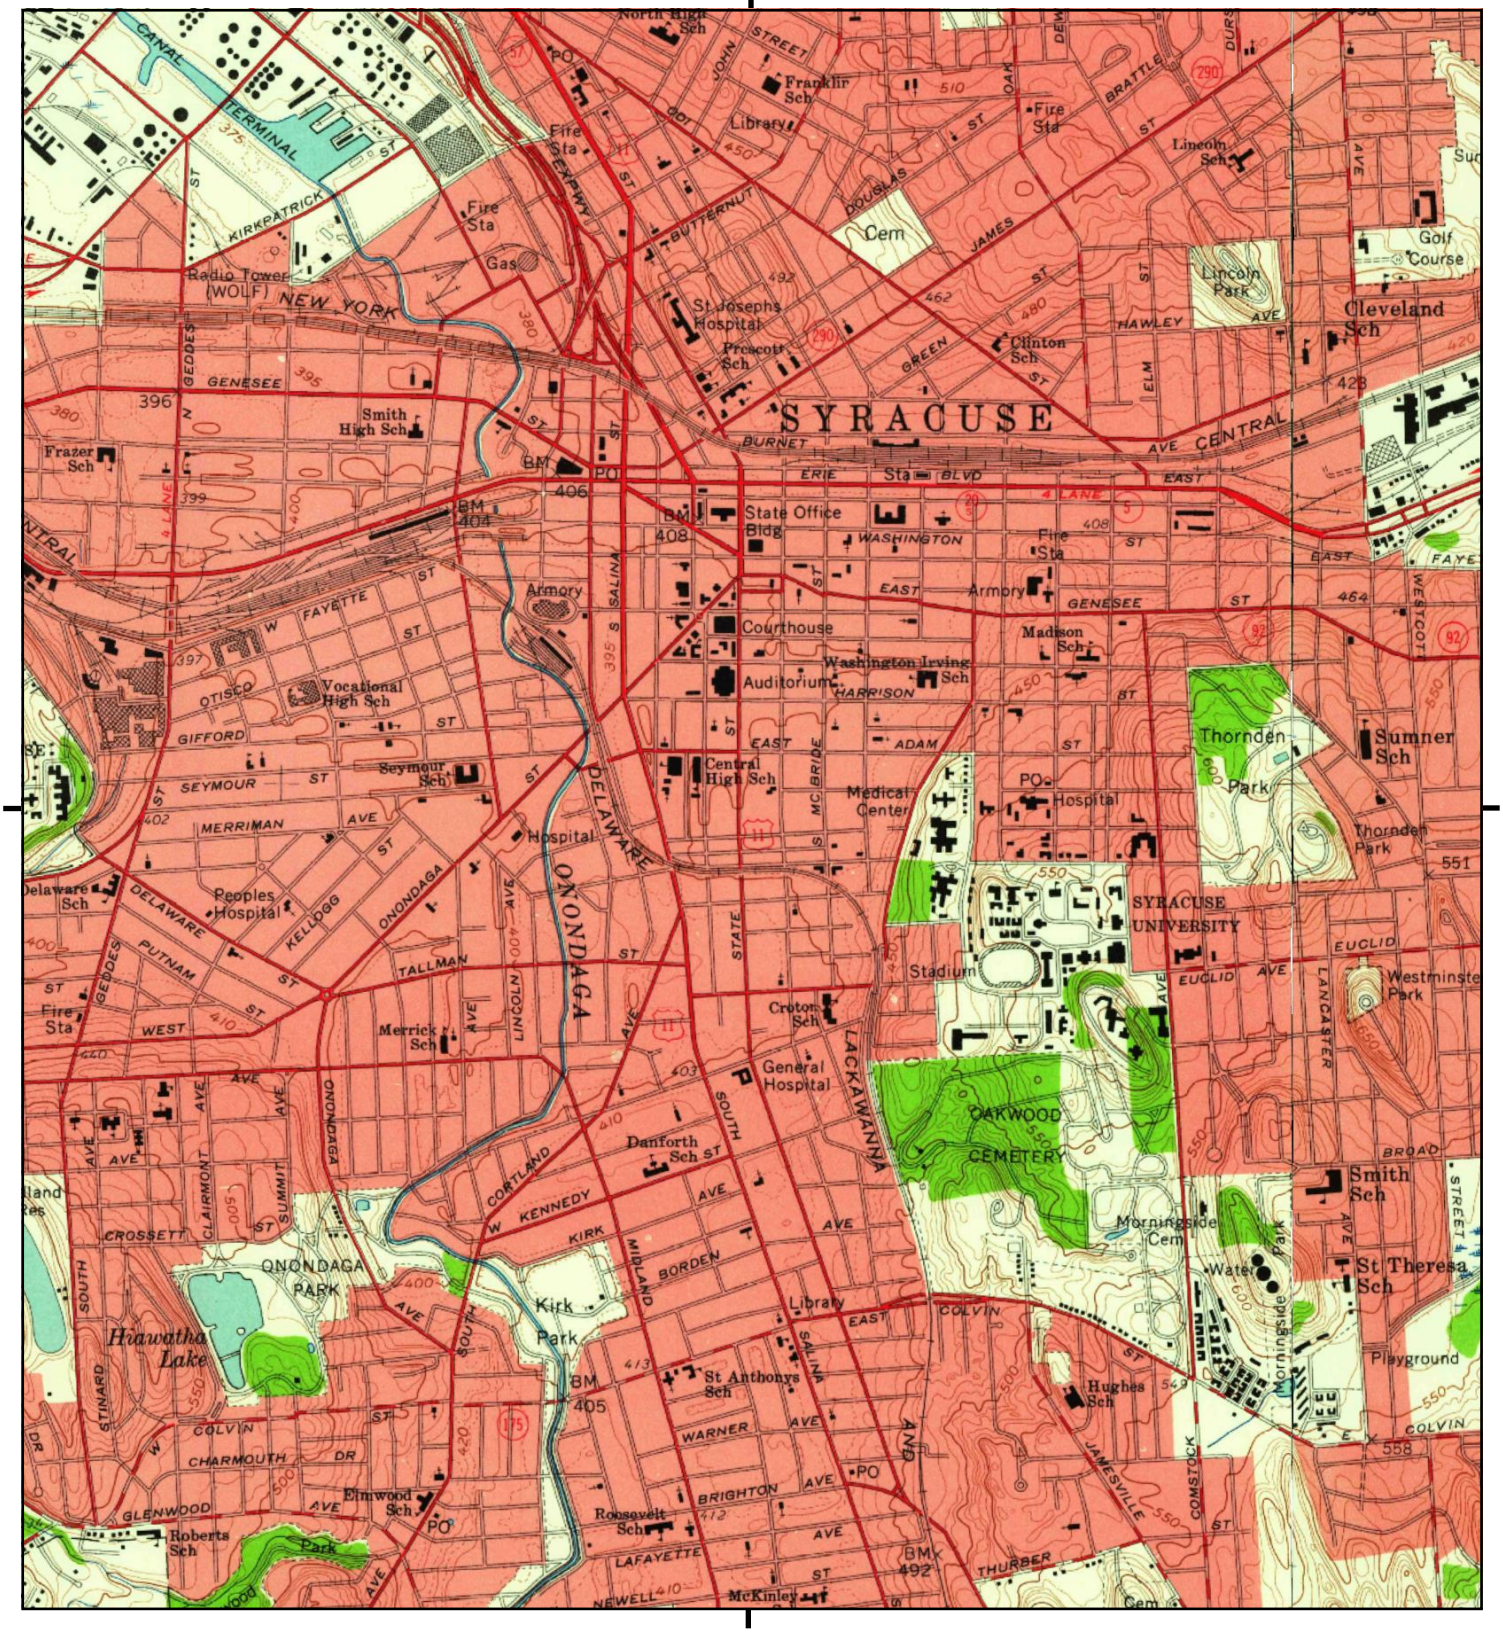

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

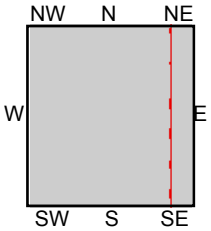

TP, Syracuse West, 1958, 7.5-minute
E, Syracuse East, 1957, 7.5-minute

SITE NAME: East Adams Redevelopment Phase Three
ADDRESS: 200 Chavez Terrace
Syracuse, NY 13202
CLIENT: Langan Engineering, Inc.

N

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

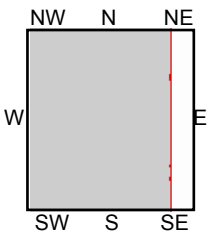

TP, Syracuse West, 1947, 7.5-minute

SITE NAME: East Adams Redevelopment Phase Three
ADDRESS: 200 Chavez Terrace
Syracuse, NY 13202
CLIENT: Langan Engineering, Inc.

N

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

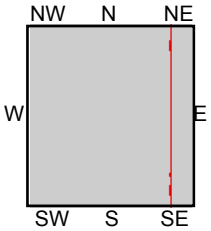

TP, Syracuse West, 1939, 7.5-minute
E, Syracuse East, 1943, 7.5-minute

SITE NAME: East Adams Redevelopment Phase Three
ADDRESS: 200 Chavez Terrace
Syracuse, NY 13202
CLIENT: Langan Engineering, Inc.

N

Historical Topo Map

1938, 1939

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Syracuse West, 1939, 7.5-minute
E, Syracuse East, 1938, 7.5-minute

SITE NAME: East Adams Redevelopment Phase Three
ADDRESS: 200 Chavez Terrace
Syracuse, NY 13202
CLIENT: Langan Engineering, Inc.

N

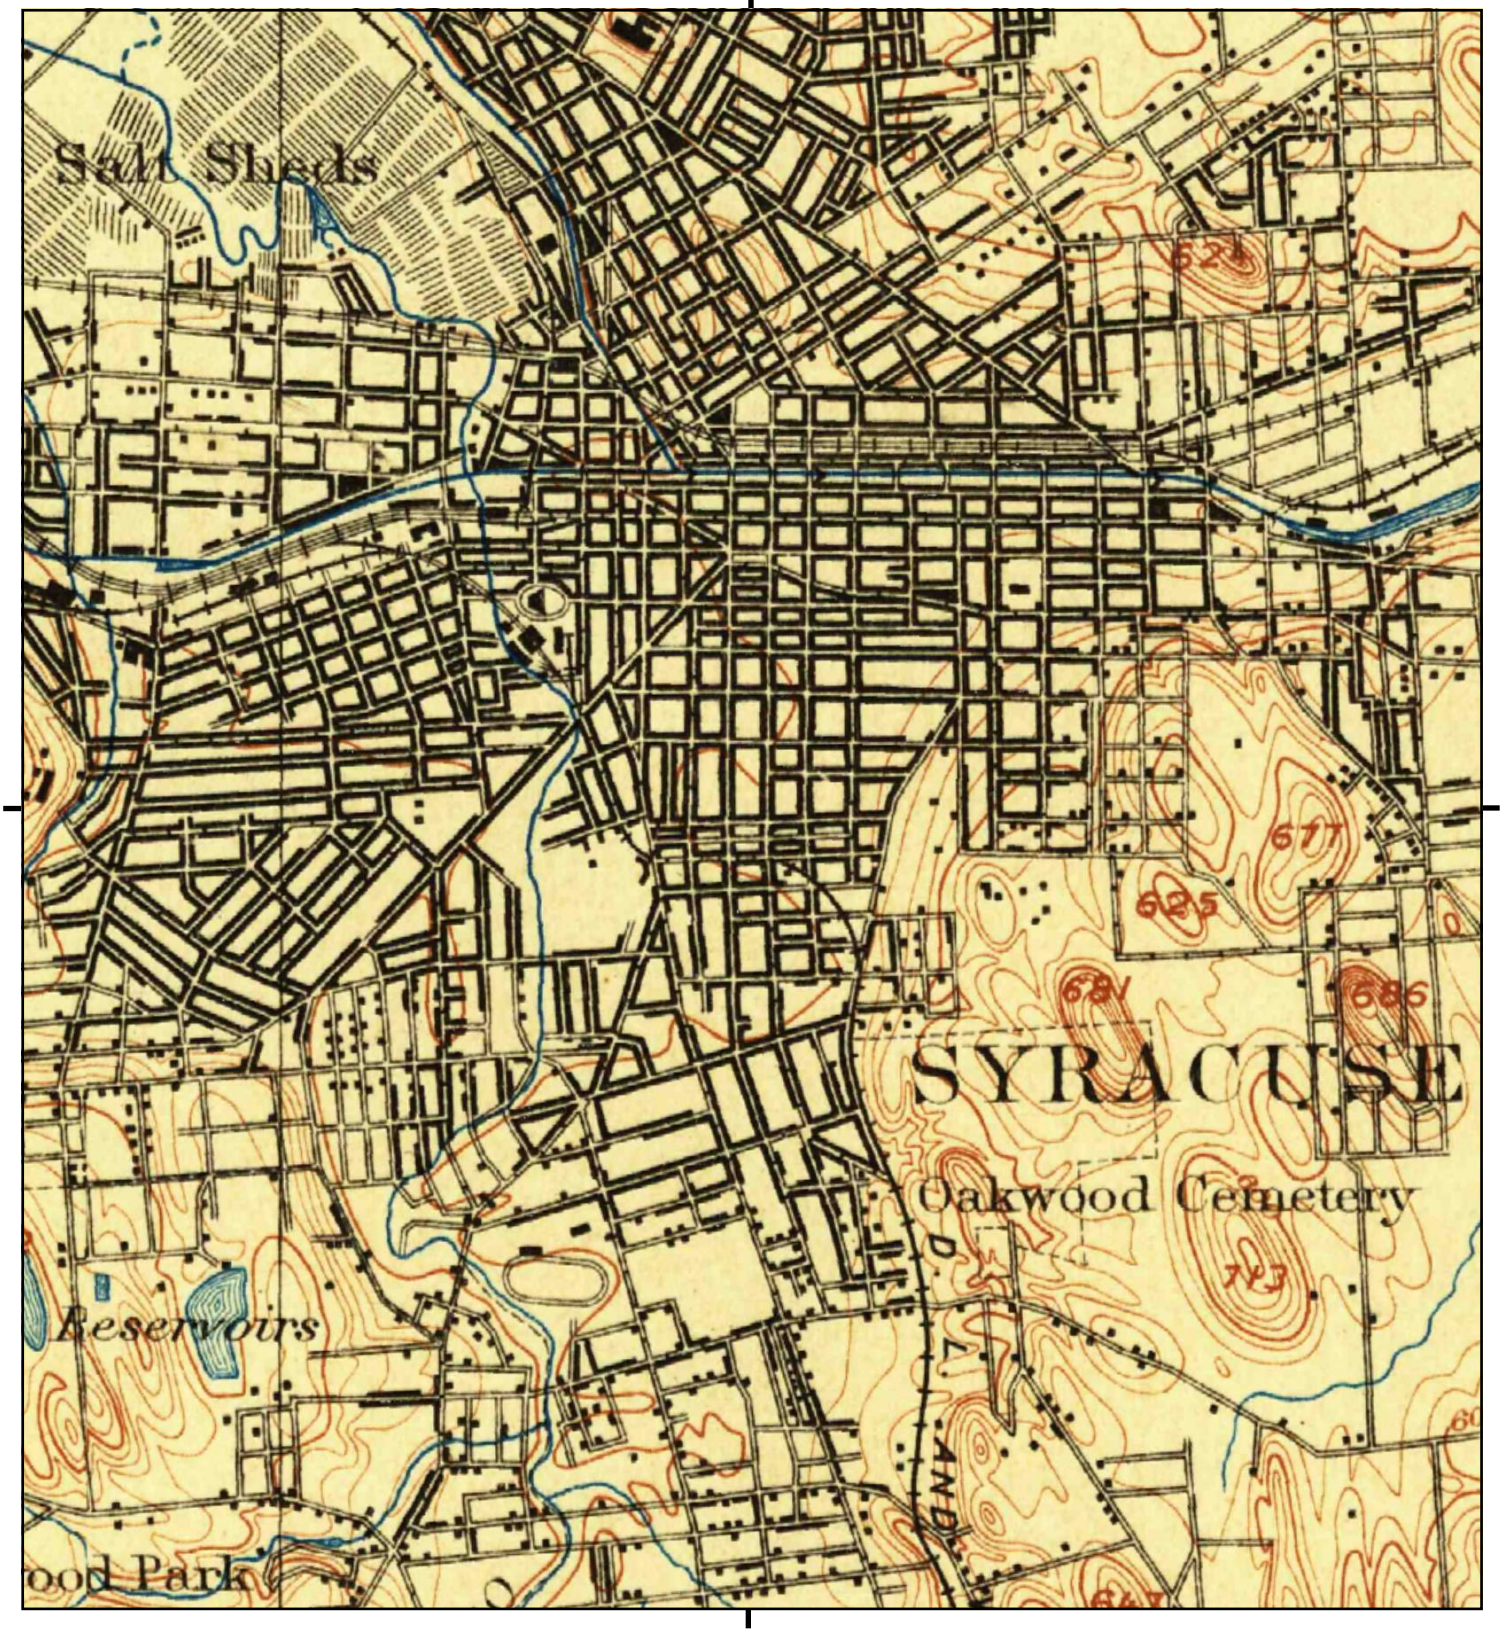

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Syracuse, 1898, 15-minute

SITE NAME: East Adams Redevelopment Phase Three
ADDRESS: 200 Chavez Terrace
Syracuse, NY 13202
CLIENT: Langan Engineering, Inc.

N

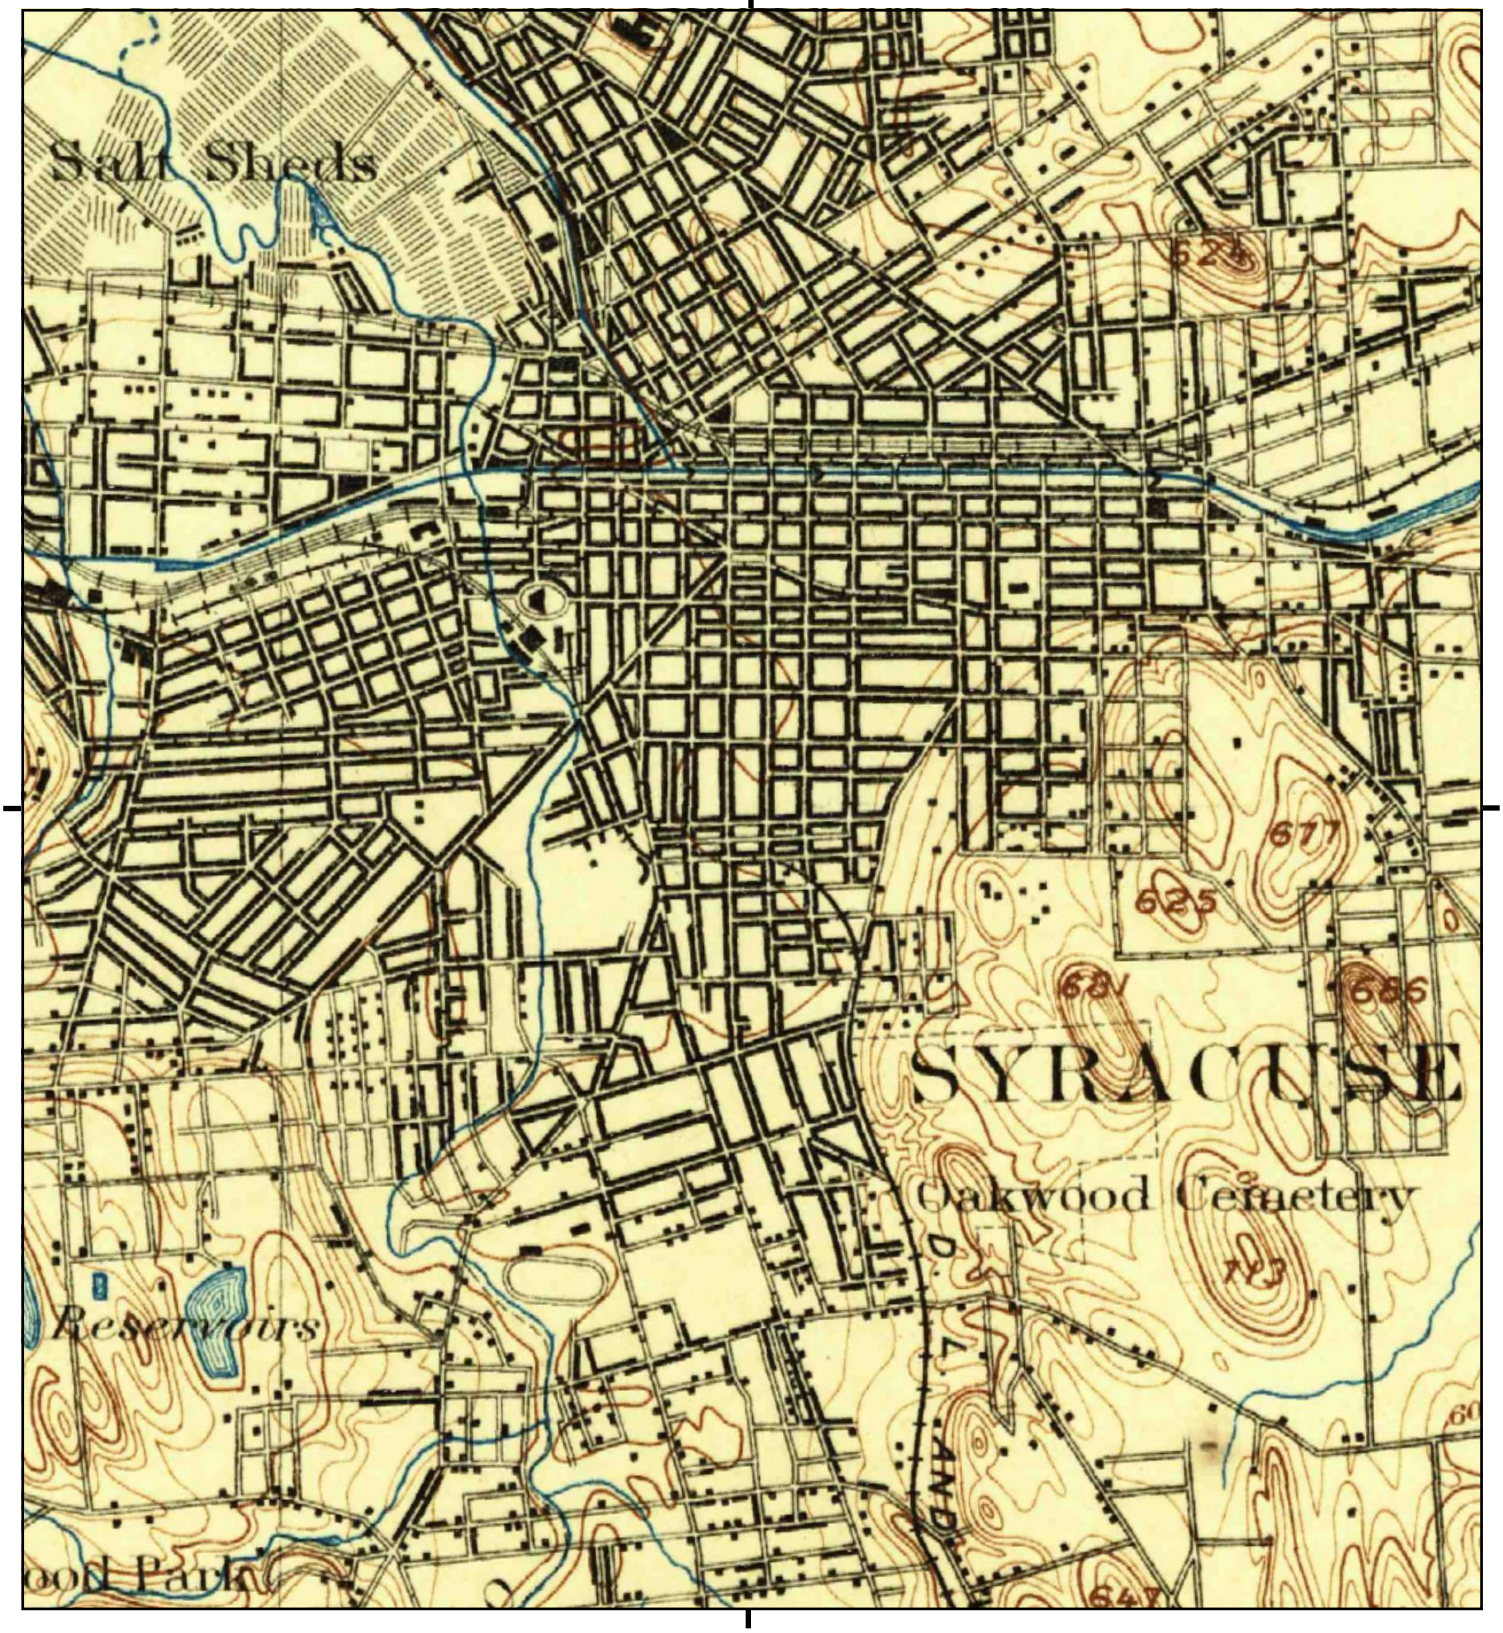

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Syracuse, 1895, 15-minute

SITE NAME: East Adams Redevelopment Phase Three
ADDRESS: 200 Chavez Terrace
Syracuse, NY 13202
CLIENT: Langan Engineering, Inc.

N

East Adams Redevelopment Phase Three Area

200 Chavez Terrace

Syracuse, NY 13202

Inquiry Number: 7748282.3

August 29, 2024

Certified Sanborn® Map Report

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

08/29/24

Site Name:	Client Name:
East Adams Redevelopment Pl	Langan Engineering, Inc.
200 Chavez Terrace	360 W. 31st Street
Syracuse, NY 13202	New York, NY 10001
EDR Inquiry # 7748282.3	Contact: Sarah Gardner

The Sanborn Library has been searched by EDR and maps covering the target property location as provided by Langan Engineering, Inc. were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # A5F4-4742-8B76

PO # 170784004

Project East Adams Redevelopment Phase

Maps Provided:

1990
1971
1968
1961
1953
1951
1910
1892

Sanborn® Library search results

Certification #: A5F4-4742-8B76

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ☑ Library of Congress
- ☑ University Publications of America
- ☑ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

Langan Engineering, Inc. (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT. Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2024 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

1990 Source Sheets

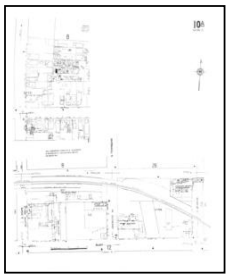
Volume 1A, Sheet 10a
1990

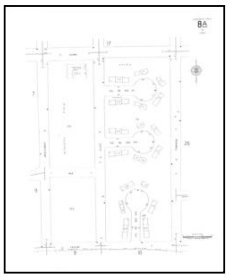
Volume 1A, Sheet 8a
1990

Volume 1A, Sheet 9a
1990

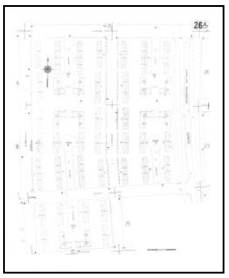
Volume 1A, Sheet 26a
1990

1971 Source Sheets

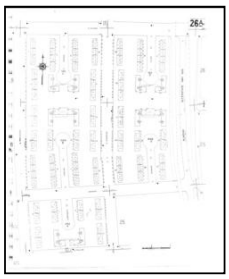
Volume 1A, Sheet 26a
1971

Volume 1A, Sheet 9a
1971

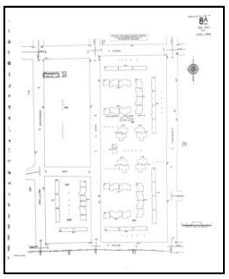
Volume 1A, Sheet 8a
1971

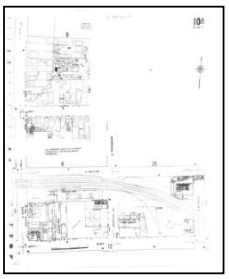
Volume 1A, Sheet 10a
1971

1968 Source Sheets

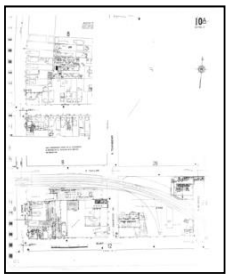
Volume 1A, Sheet 10a
1968

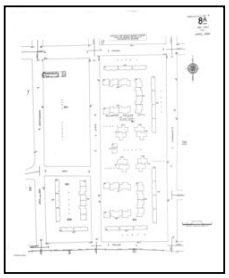
Volume 1A, Sheet 8a
1968

Volume 1A, Sheet 9a
1968

Volume 1A, Sheet 26a
1968

1961 Source Sheets

Volume 1A, Sheet 26a
1961

Volume 1A, Sheet 9a
1961

Volume 1A, Sheet 10a
1961

Volume 1A, Sheet 8a
1961

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

1953 Source Sheets

Volume 1A, Sheet 8a
1953

Volume 1A, Sheet 10a
1953

Volume 1A, Sheet 9a
1953

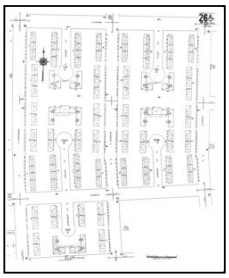

Volume 1A, Sheet 26a
1953

1951 Source Sheets

Volume 1, Sheet 89
1951

Volume 1, Sheet 9
1951

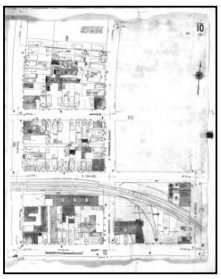

Volume 1, Sheet 10
1951

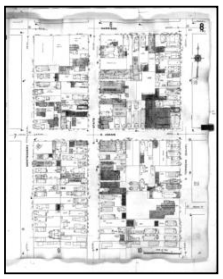

Volume 1, Sheet 8
1951

1910 Source Sheets

Volume 1, Sheet 10
1910

Volume 1, Sheet 9
1910

Volume 1, Sheet 8
1910

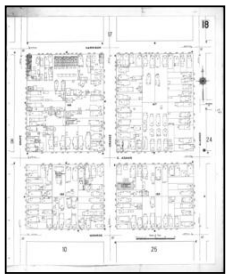

Volume 1, Sheet 18
1910

1892 Source Sheets

Volume 1, Sheet 58
1892

Volume 1, Sheet 48
1892

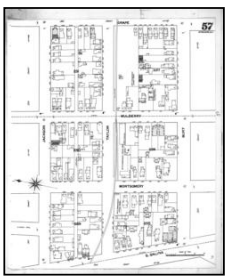

Volume 1, Sheet 57
1892

Volume 1, Sheet 49
1892

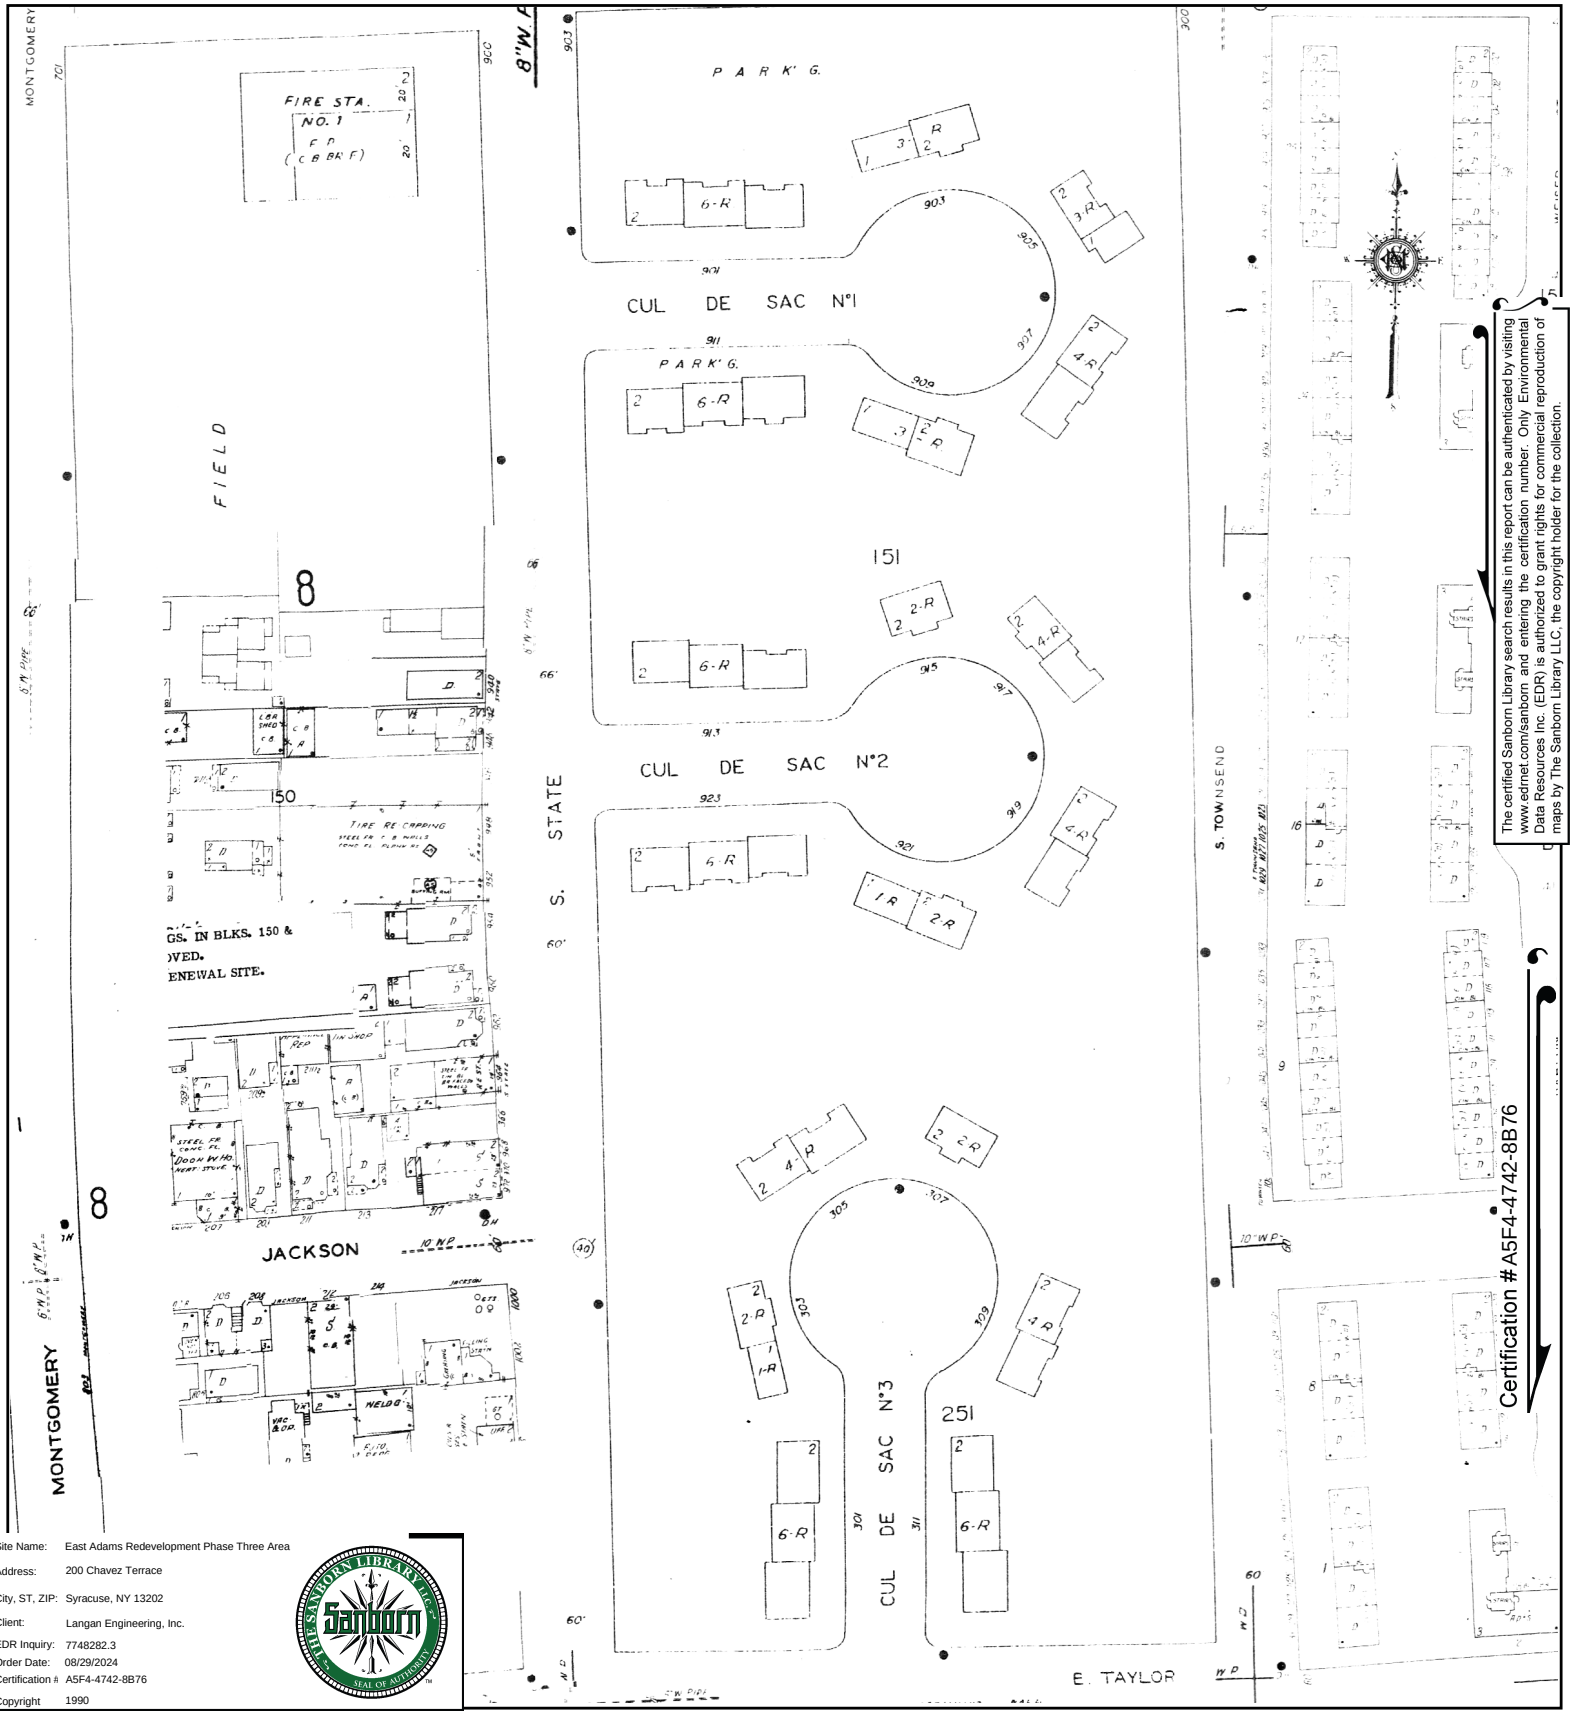

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A5F4-4742-8B76

Site Name:	East Adams Redevelopment Phase Three Area
Address:	200 Chavez Terrace
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan Engineering, Inc.
EDR Inquiry:	7748282.3
Order Date:	08/29/2024
Certification #:	A5F4-4742-8B76
Copyright	1990

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

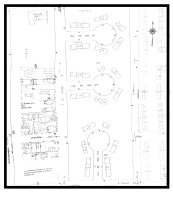

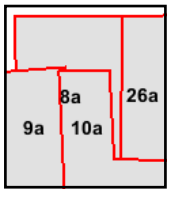

Volume 1A, Sheet 26a
Volume 1A, Sheet 9a
Volume 1A, Sheet 8a
Volume 1A, Sheet 10a

0 Feet 150 300 600

N

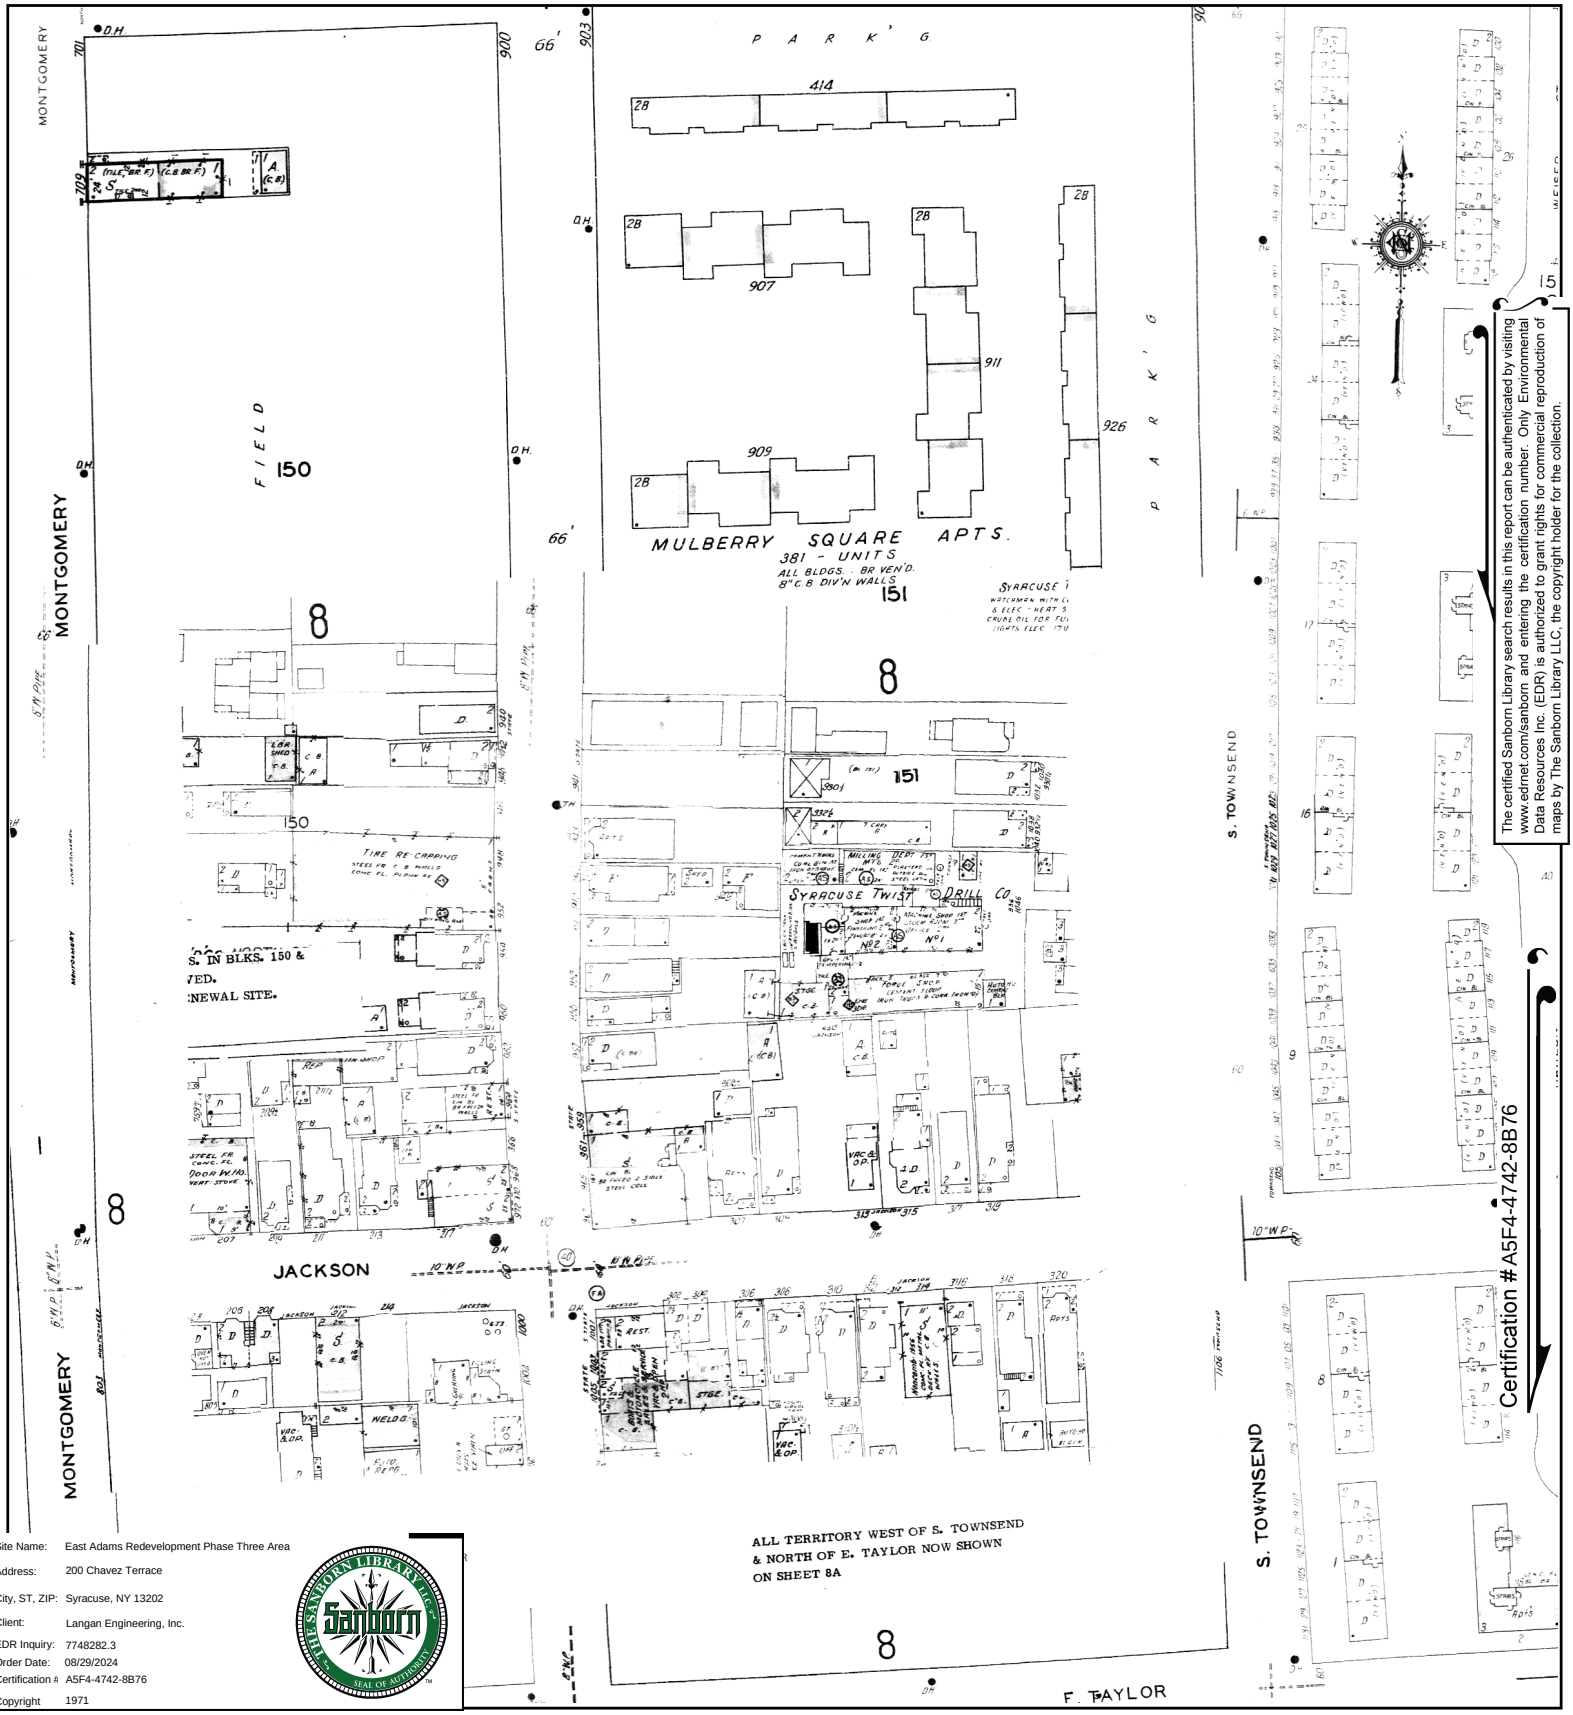

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A5F4-4742-8B76

Site Name:	East Adams Redevelopment Phase Three Area
Address:	200 Chavez Terrace
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan Engineering, Inc.
EDR Inquiry:	7748282.3
Order Date:	08/29/2024
Certification #	A5F4-4742-8B76
Copyright	1971

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

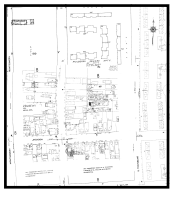

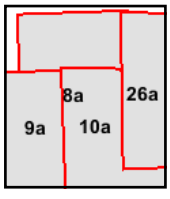

Volume 1A, Sheet 10a
Volume 1A, Sheet 8a
Volume 1A, Sheet 9a
Volume 1A, Sheet 26a

0 Feet 150 300 600

N

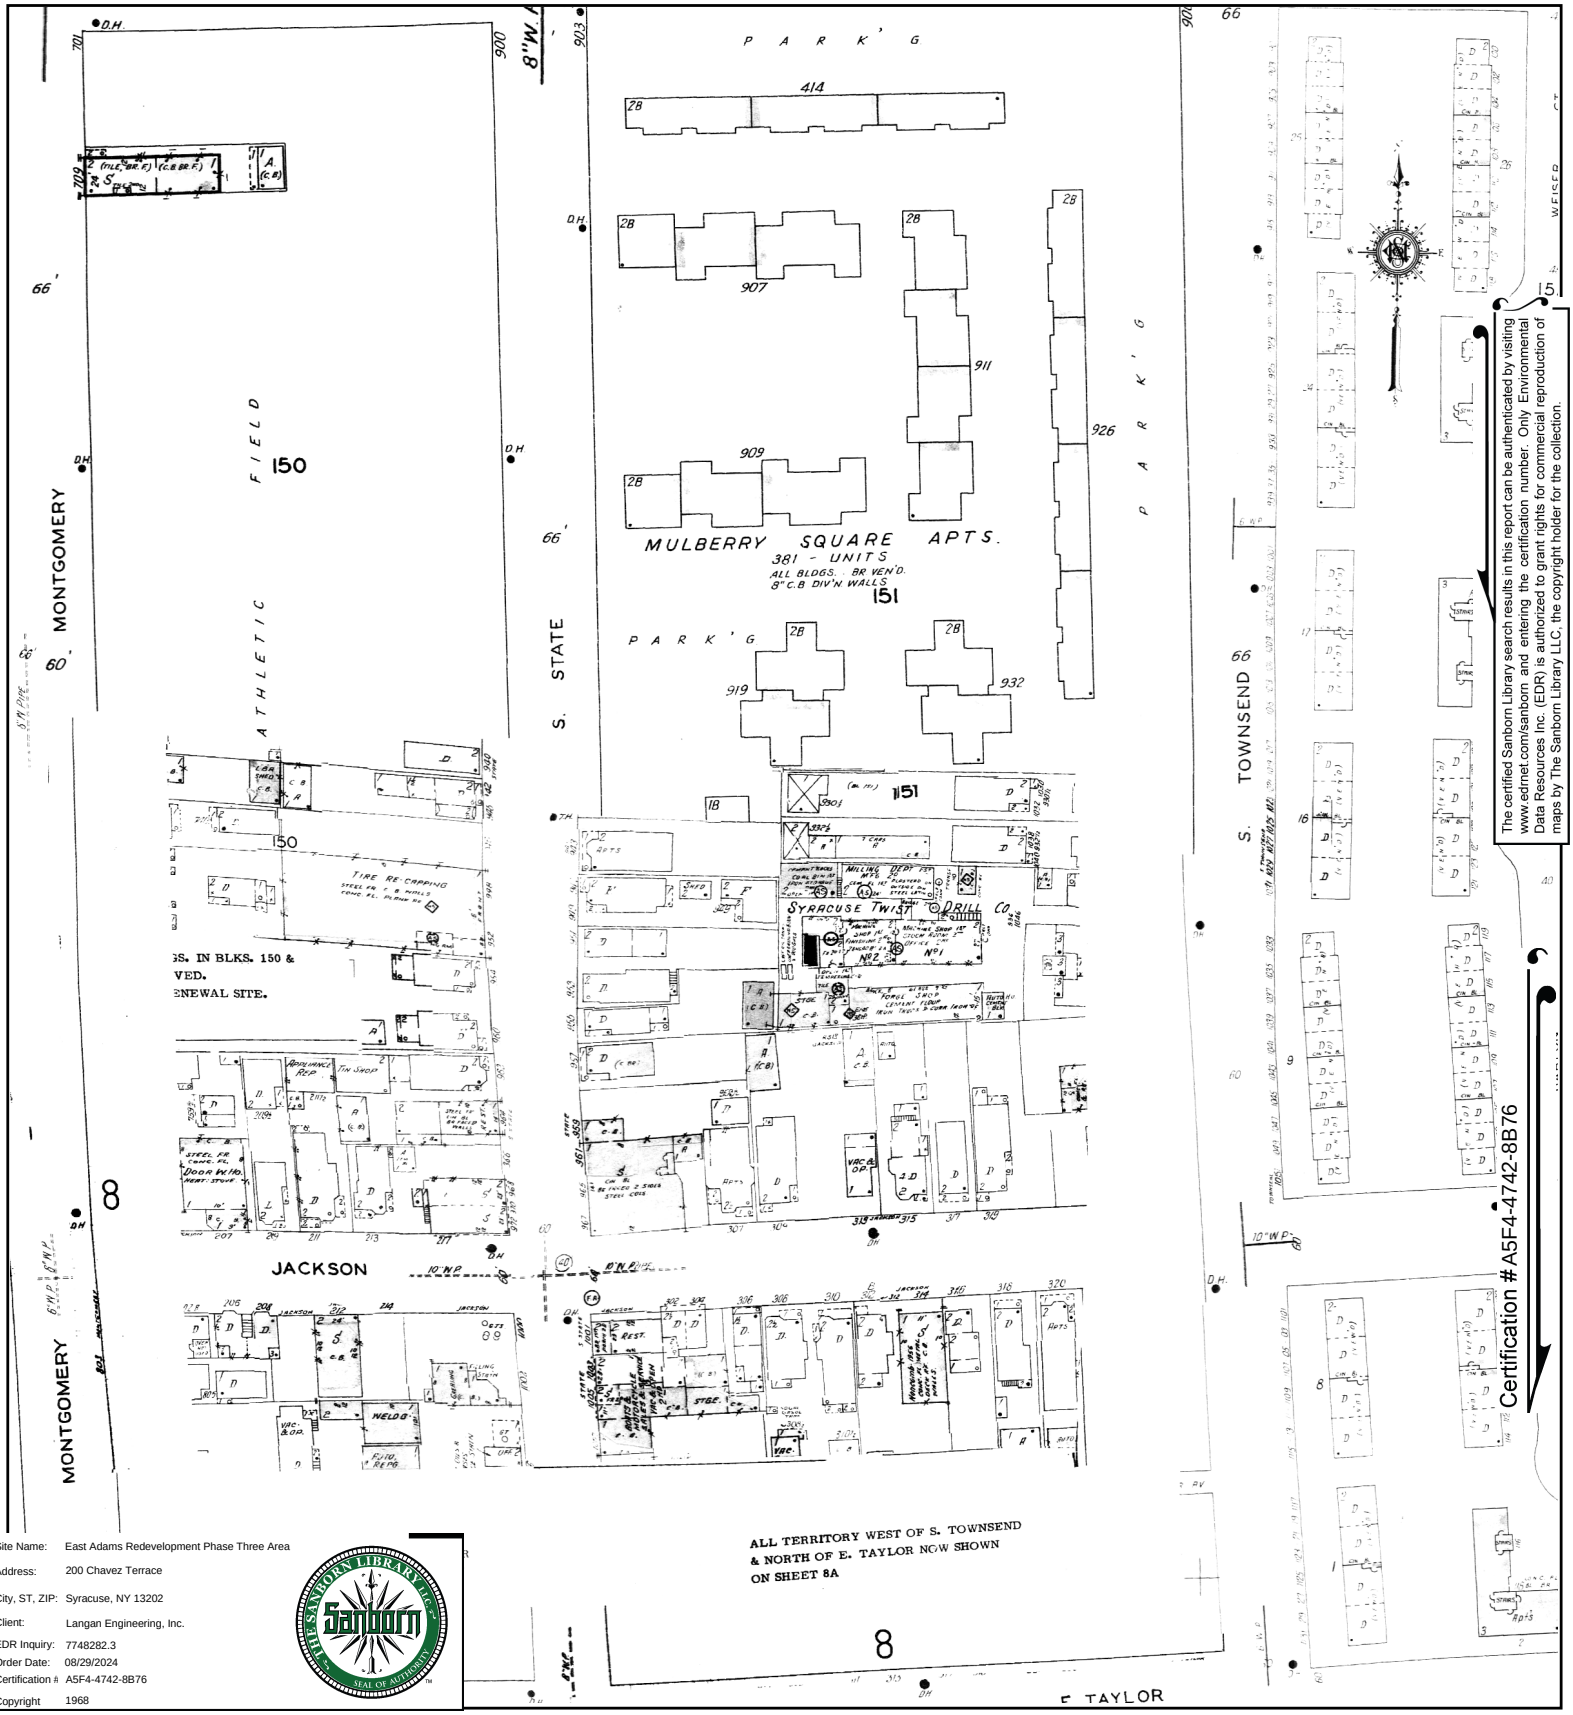

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	East Adams Redevelopment Phase Three Area
Address:	200 Chavez Terrace
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan Engineering, Inc.
EDR Inquiry:	7748282.3
Order Date:	08/29/2024
Certification #	A5F4-4742-8B76
Copyright	1968

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

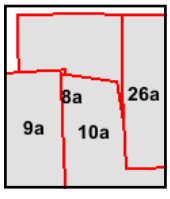

Volume 1A, Sheet 26a
Volume 1A, Sheet 9a
Volume 1A, Sheet 8a
Volume 1A, Sheet 10a

0 Feet 150 300 600

N

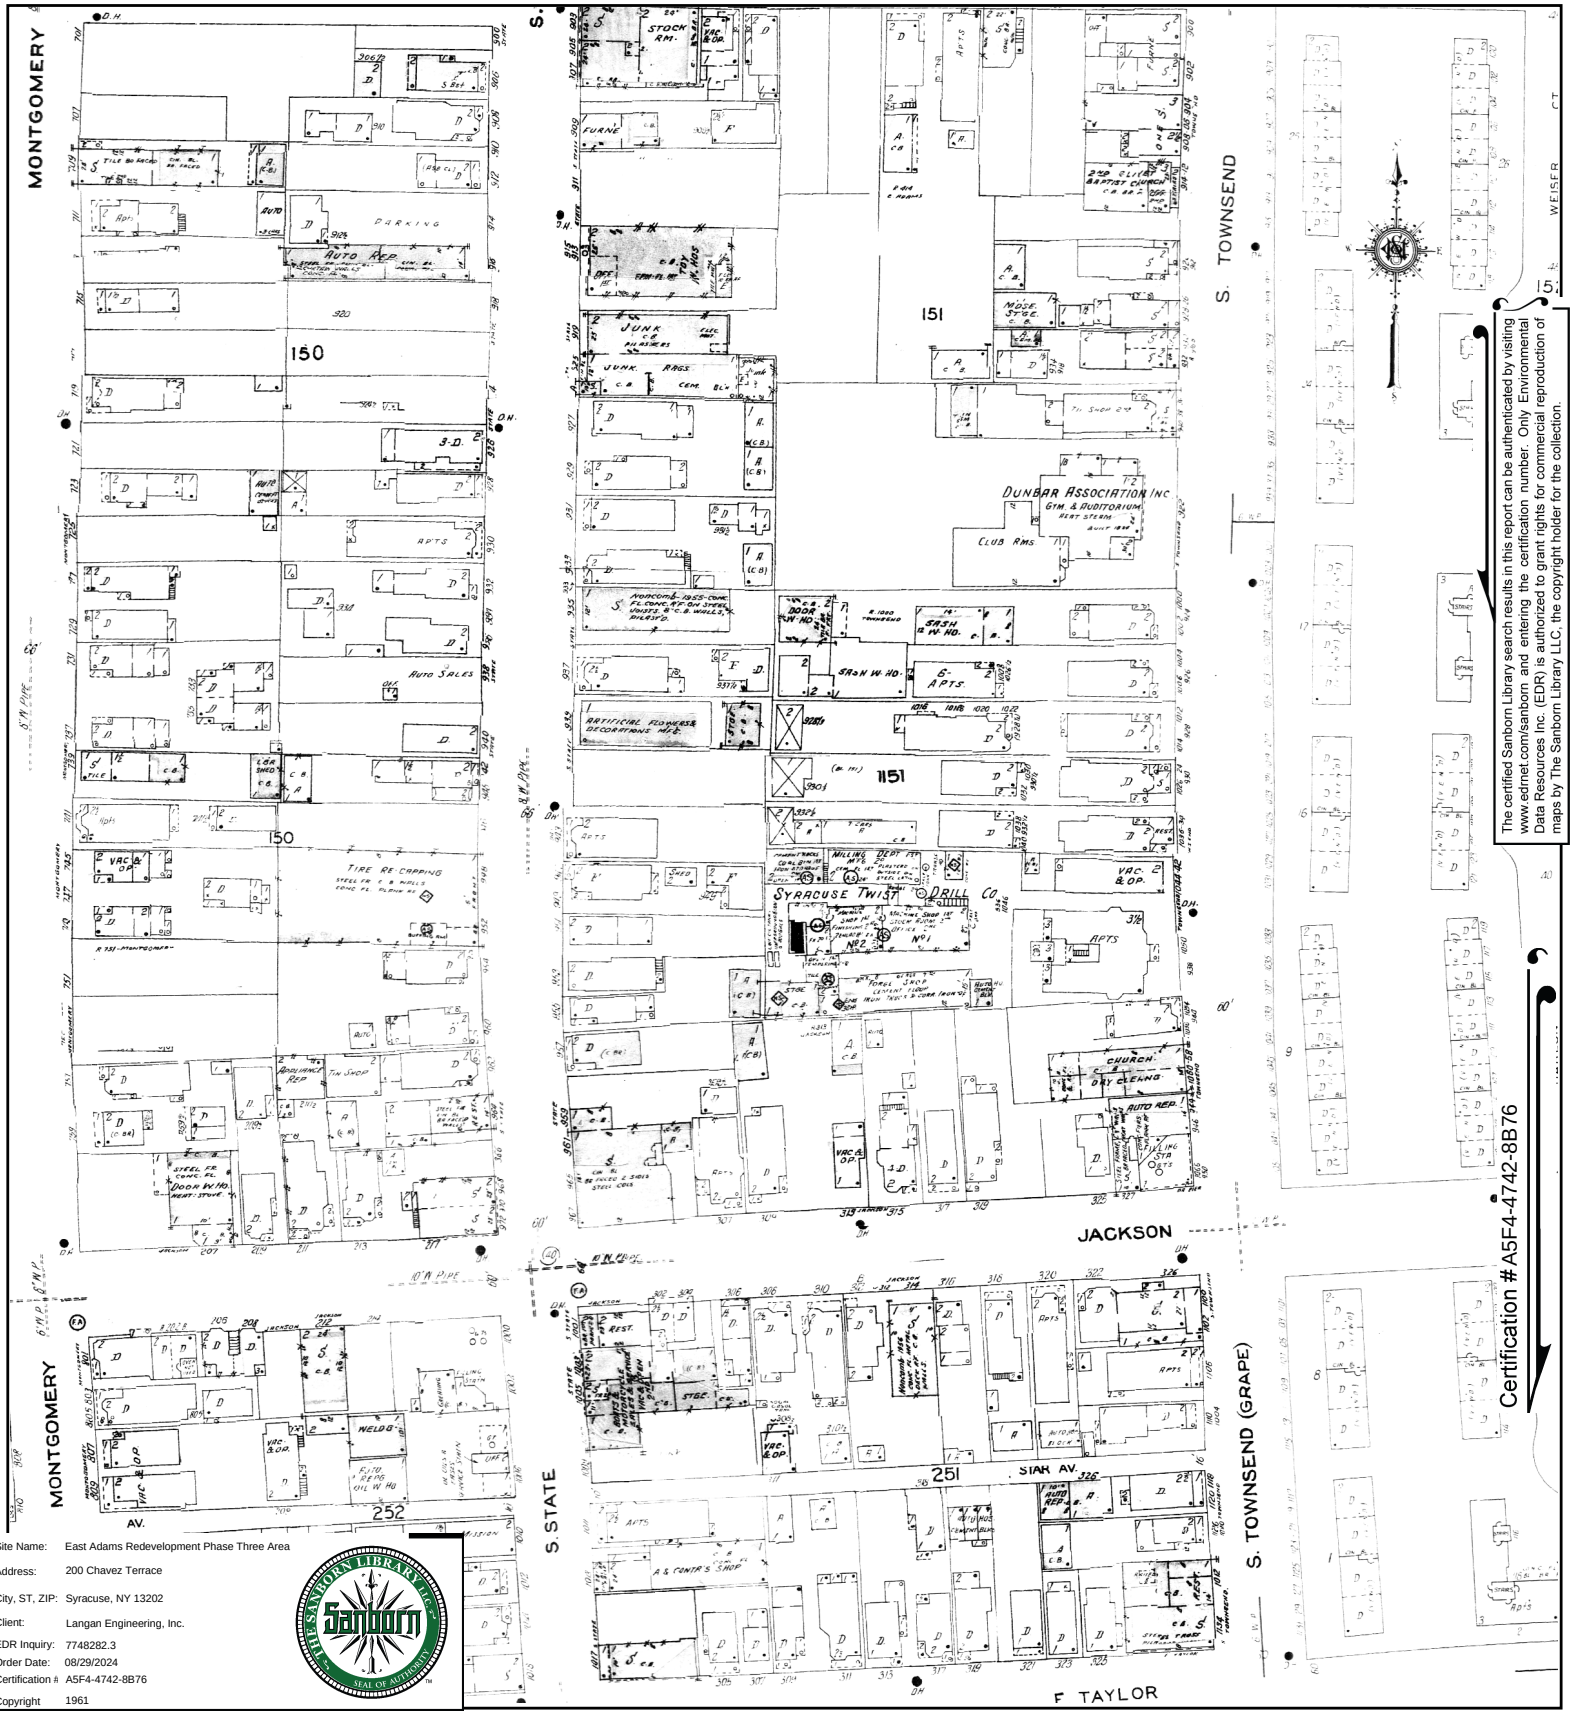

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	East Adams Redevelopment Phase Three Area
Address:	200 Chavez Terrace
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan Engineering, Inc.
EDR Inquiry:	7748282.3
Order Date:	08/29/2024
Certification #	A5F4-4742-8B76
Copyright	1961

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

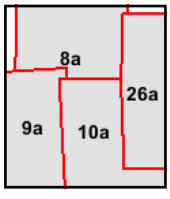

Volume 1A, Sheet 8a
Volume 1A, Sheet 10a
Volume 1A, Sheet 9a
Volume 1A, Sheet 26a

0 Feet 150 300 600

N

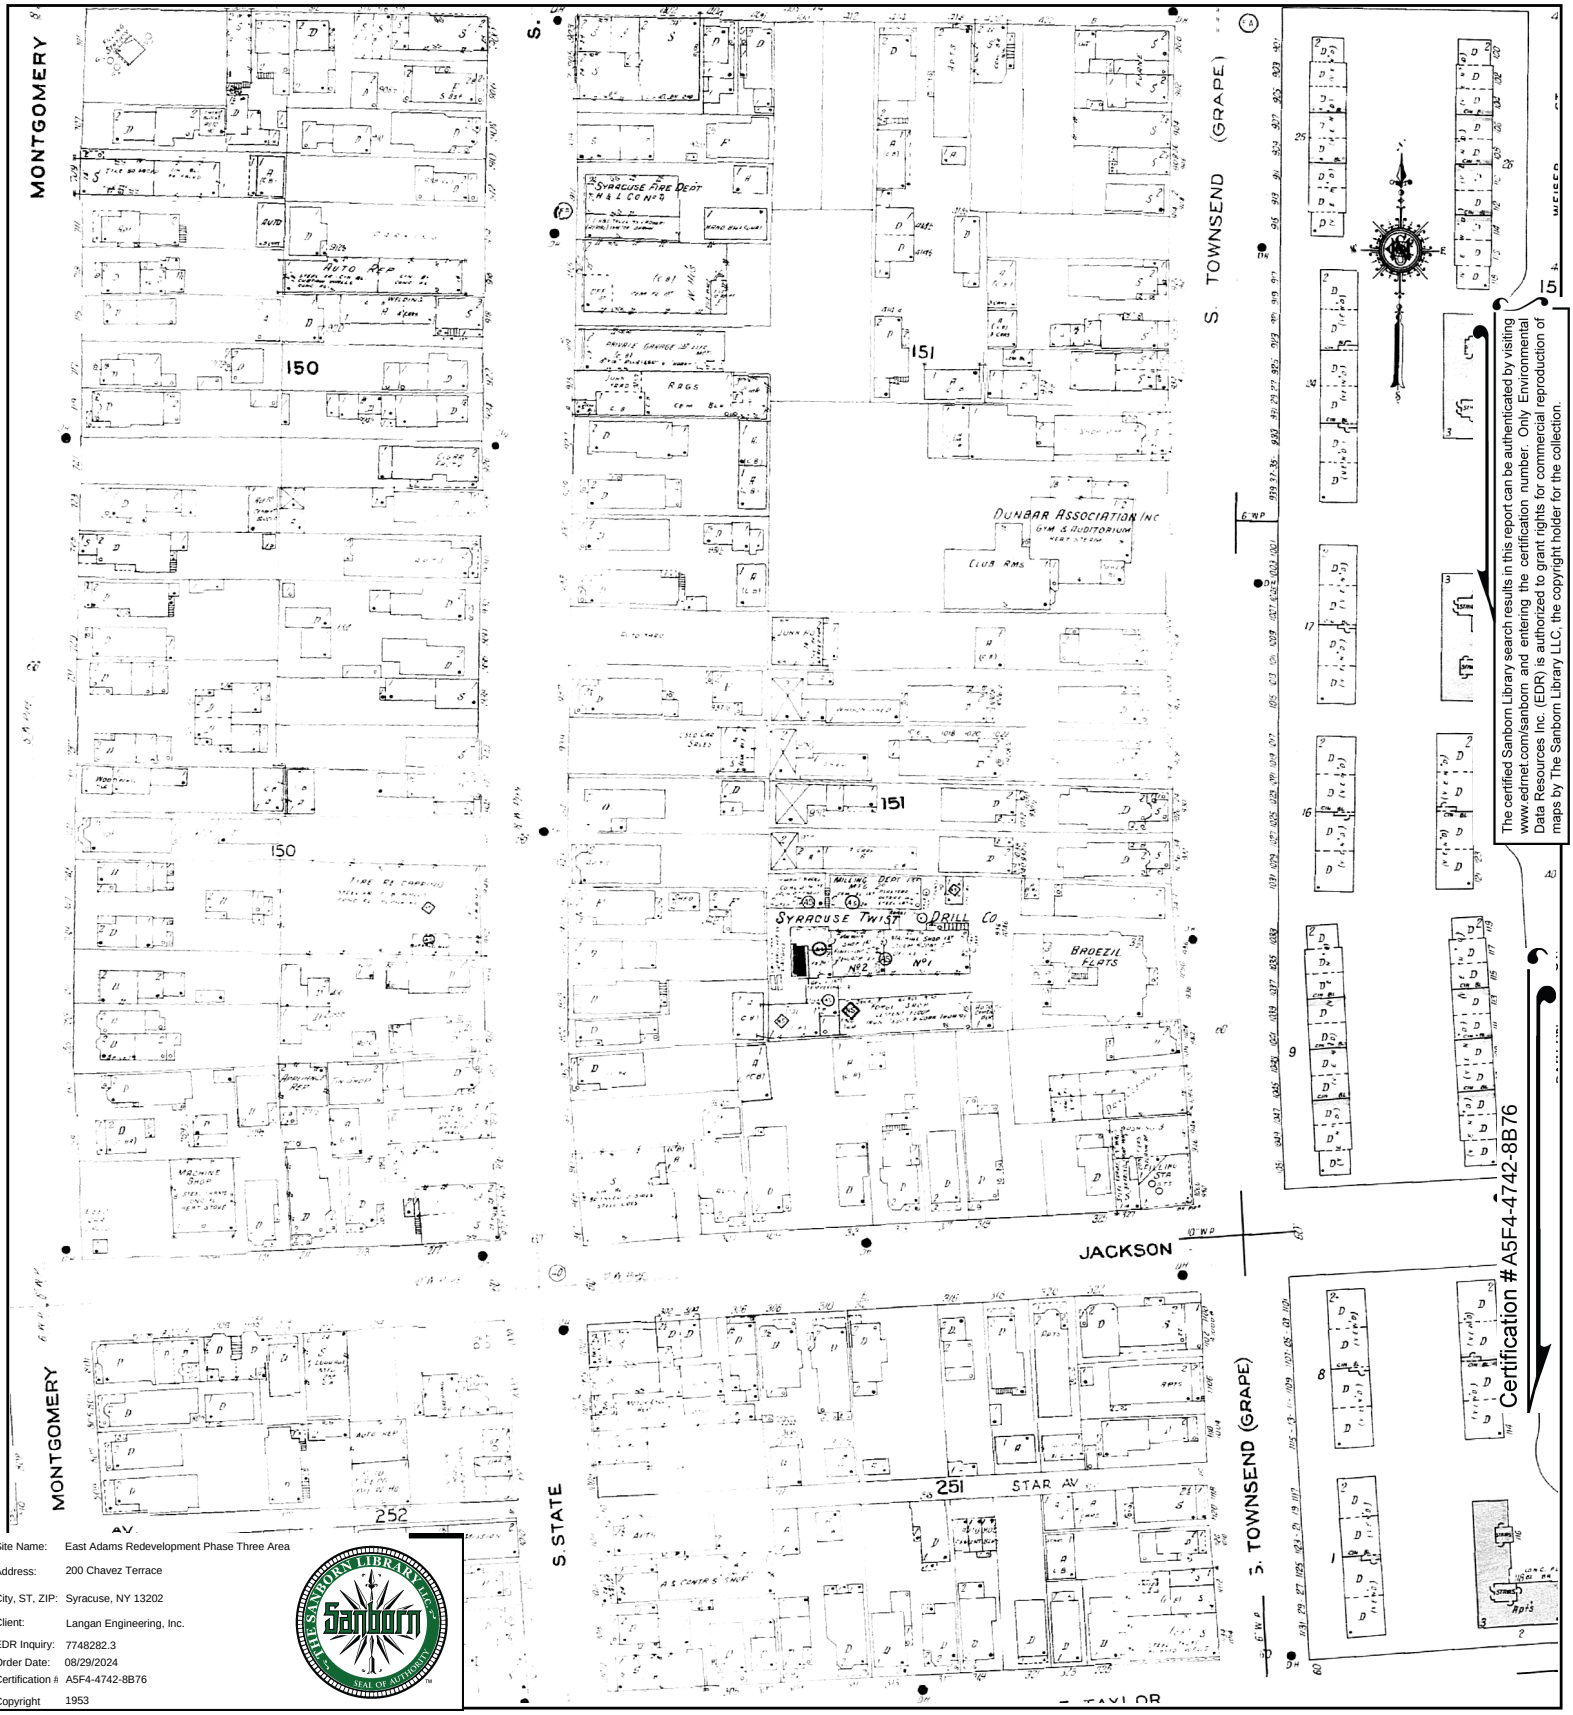

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A5F4-4742-8B76

Site Name:	East Adams Redevelopment Phase Three Area
Address:	200 Chavez Terrace
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan Engineering, Inc.
EDR Inquiry:	7748282.3
Order Date:	08/29/2024
Certification #	A5F4-4742-8B76
Copyright	1953

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

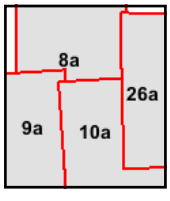

Volume 1A, Sheet 26a
Volume 1A, Sheet 9a
Volume 1A, Sheet 10a
Volume 1A, Sheet 8a

0 Feet 150 300 600

N

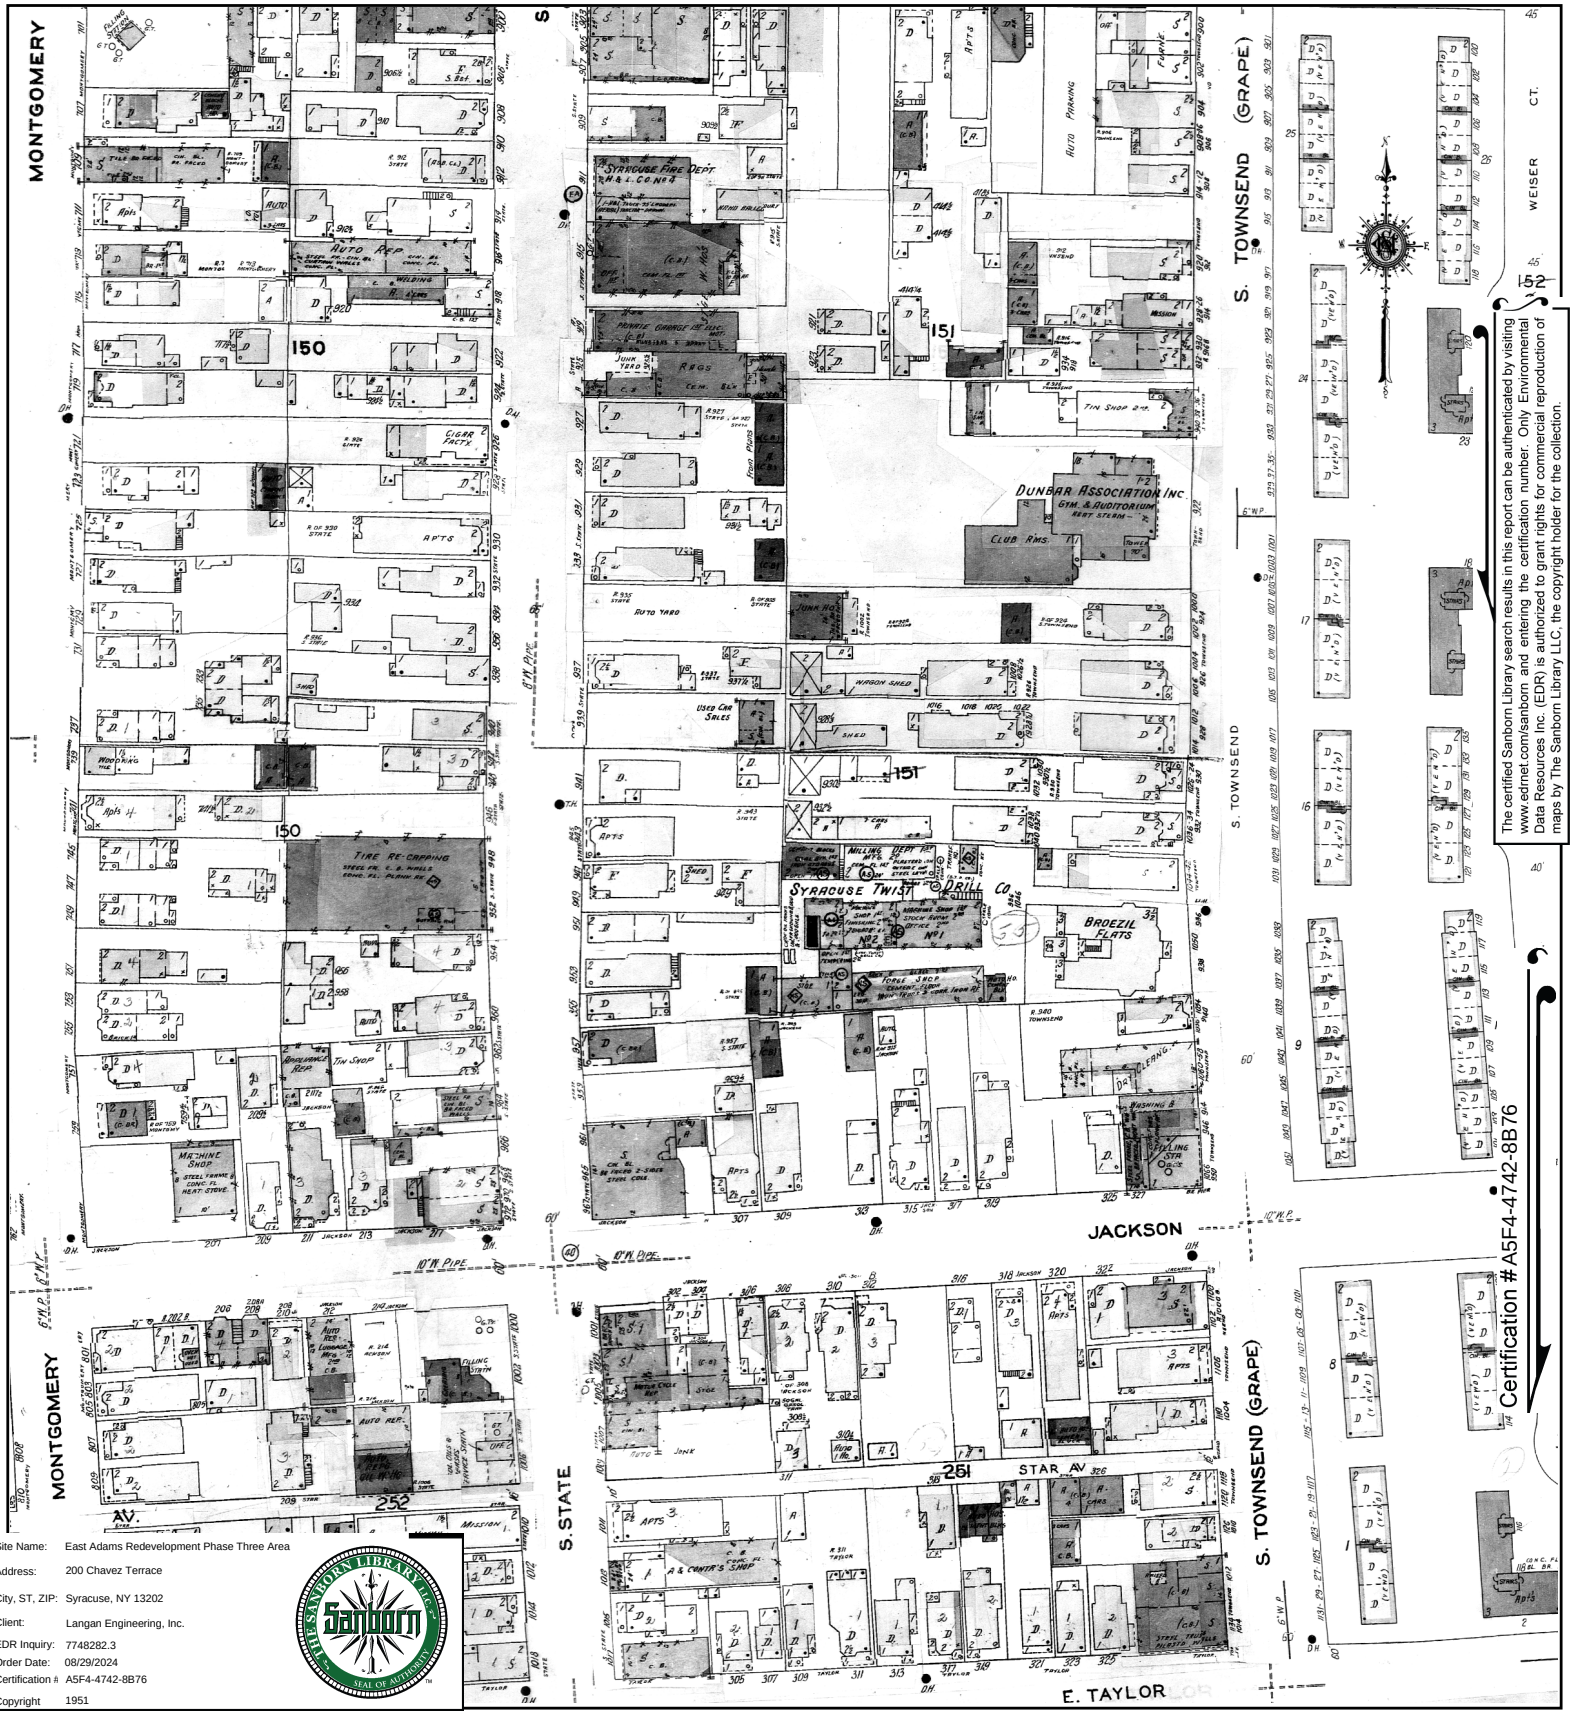

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	East Adams Redevelopment Phase Three Area
Address:	200 Chavez Terrace
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan Engineering, Inc.
EDR Inquiry:	7748282.3
Order Date:	08/29/2024
Certification #:	A5F4-4742-8B76
Copyright	1951

THE SANBORN LIBRARY LLC Sanborn SEAL OF AUTHENTICITY

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

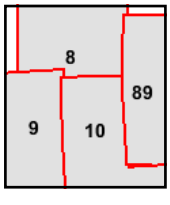

Volume 1, Sheet 8
Volume 1, Sheet 10
Volume 1, Sheet 9
Volume 1, Sheet 89

0 Feet 150 300 600

N

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	East Adams Redevelopment Phase Three Area
Address:	200 Chavez Terrace
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan Engineering, Inc.
EDR Inquiry:	7748282.3
Order Date:	08/29/2024
Certification #:	A5F4-4742-8B76
Copyright	1910

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

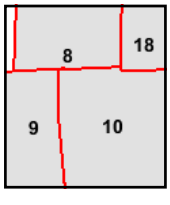

Volume 1, Sheet 18
Volume 1, Sheet 8
Volume 1, Sheet 9
Volume 1, Sheet 10

0 Feet 150 300 600

N

Certified Sanborn® Map

1892

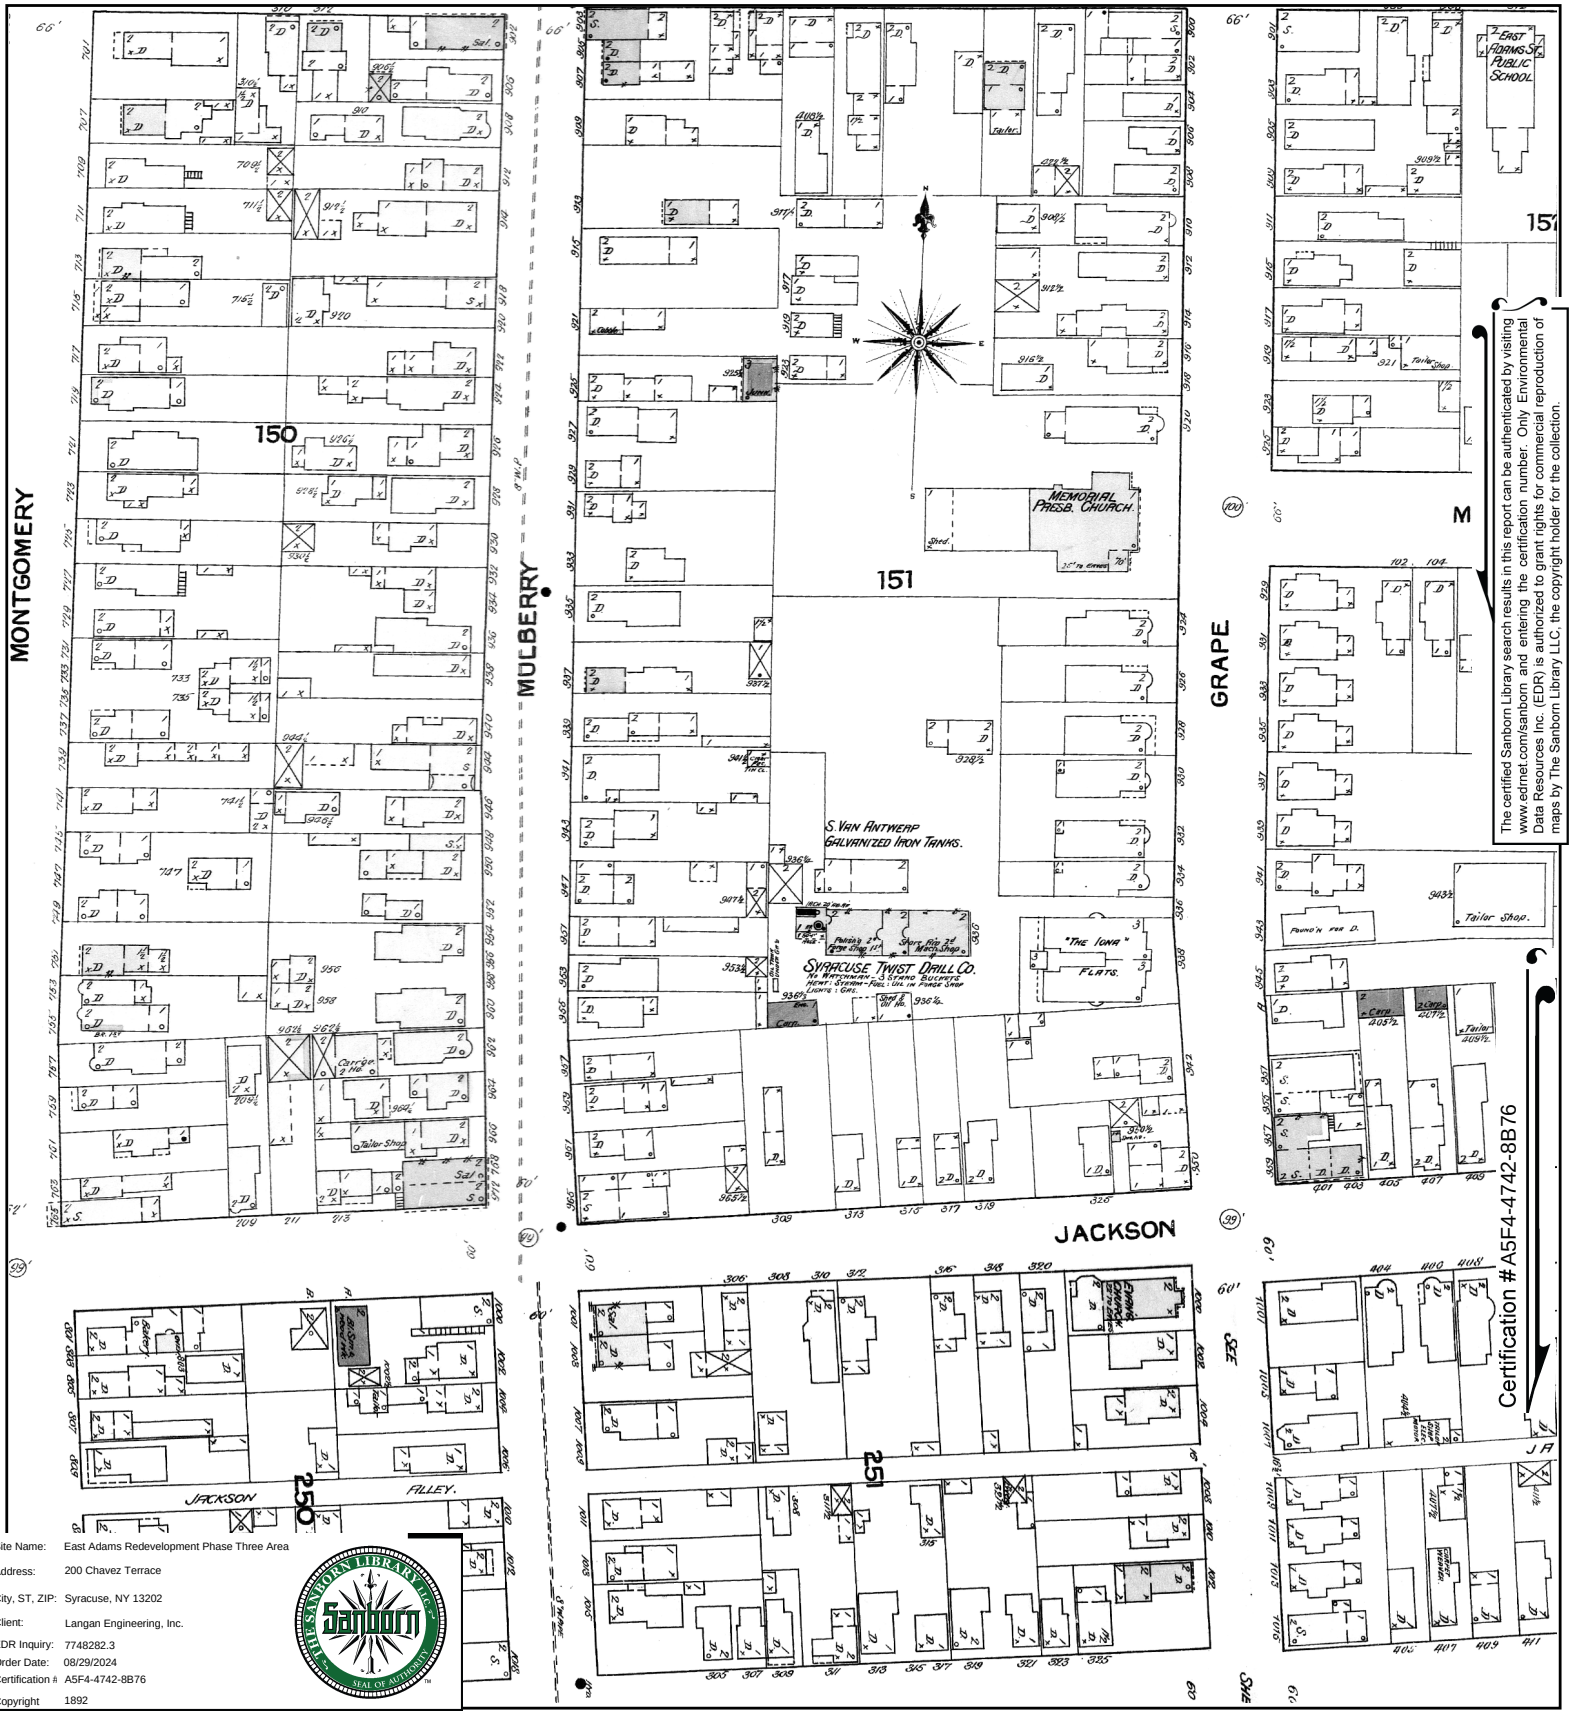

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	East Adams Redevelopment Phase Three Area
Address:	200 Chavez Terrace
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan Engineering, Inc.
EDR Inquiry:	7748282.3
Order Date:	08/29/2024
Certification #:	A5F4-4742-8B76
Copyright	1892

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

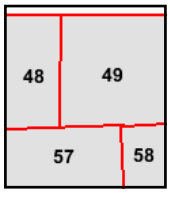

Volume 1, Sheet 49
Volume 1, Sheet 57
Volume 1, Sheet 48
Volume 1, Sheet 58

0 Feet 150 300 600

N

East Adams Redevelopment Phase Three Area
200 Chavez Terrace
Syracuse, NY 13202

Inquiry Number: 7748282.5
August 30, 2024

The EDR-City Directory Image Report

EDR® Environmental Data Resources Inc

6 Armstrong Road
Shelton, CT 06484
800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION

Executive Summary

Findings

City Directory Images

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. **NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT.** Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2023 by Environmental Data Resources, LLC. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, LLC, or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Report is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Report includes a search of available business directory data at approximately five year intervals.

RECORD SOURCES

The EDR City Directory Report accesses a variety of business directory sources, including Haines, InfoUSA, Polk, Cole, Bresser, and Stewart. Listings marked as EDR Digital Archive access Cole and InfoUSA records. The various directory sources enhance and complement each other to provide a more thorough and accurate report.

EDR is licensed to reproduce certain City Directory works by the copyright holders of those works. The purchaser of this EDR City Directory Report may include it in report(s) delivered to a customer.

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. A check mark indicates where information was identified in the source and provided in this report.

Year	Target Street	Cross Street	Source
2020	☑	☑	EDR Digital Archive
2017	☑	☑	Cole Information
2014	☑	☑	Cole Information
2010	☑	☑	Cole Information
2005	☑	☑	Cole Information
2000	☑	☑	Cole Information
1995	☑	☑	Cole Information
1992	☐	☑	Cole Information
1988	☐	☑	Polk's City Directory
1983	☐	☑	Polk's City Directory
1977	☐	☑	Polk's City Directory
1972	☐	☑	Polk's City Directory
1968	☐	☑	Polk's City Directory
1964	☐	☑	Polk's City Directory
1959	☐	☑	Polk's City Directory
1955	☐	☑	Haines Criss-Cross Directory
1949	☐	☑	Polk's City Directory
1944	☐	☑	Polk's City Directory
1939	☐	☑	Polk's City Directory

FINDINGS

TARGET PROPERTY STREET

200 Chavez Terrace
Syracuse, NY 13202

Year	*CD Image*	*Source*	
CHAVEZ TER			
2020	pg A1	EDR Digital Archive	
2017	pg A5	Cole Information	
2014	pg A8	Cole Information	
2010	pg A11	Cole Information	
2005	pg A15	Cole Information	
2000	pg A18	Cole Information	
1995	pg A21	Cole Information	
1992	-	Cole Information	Target and Adjoining not listed in Source
1988	-	Polk's City Directory	Street not listed in Source
1983	-	Polk's City Directory	Street not listed in Source
1977	-	Polk's City Directory	Street not listed in Source
1972	-	Polk's City Directory	Street not listed in Source
1968	-	Polk's City Directory	Street not listed in Source
1964	-	Polk's City Directory	Street not listed in Source
1959	-	Polk's City Directory	Street not listed in Source
1955	-	Haines Criss-Cross Directory	Street not listed in Source
1949	-	Polk's City Directory	Street not listed in Source
1944	-	Polk's City Directory	Street not listed in Source
1939	-	Polk's City Directory	Street not listed in Source

FINDINGS

CROSS STREETS

Year	*CD Image*	*Source*
S STATE ST		
2020	pg. A2	EDR Digital Archive
2017	pg. A6	Cole Information
2014	pg. A9	Cole Information
2010	pg. A12	Cole Information
2005	pg. A16	Cole Information
2000	pg. A19	Cole Information
1995	pg. A22	Cole Information
1992	pg. A24	Cole Information
1988	pg. A26	Polk's City Directory
1983	pg. A27	Polk's City Directory
1983	pg. A28	Polk's City Directory
1983	pg. A29	Polk's City Directory
1977	pg. A30	Polk's City Directory
1977	pg. A31	Polk's City Directory
1977	pg. A32	Polk's City Directory
1972	pg. A33	Polk's City Directory
1972	pg. A34	Polk's City Directory
1972	pg. A35	Polk's City Directory
1968	pg. A36	Polk's City Directory
1964	pg. A37	Polk's City Directory
1964	pg. A38	Polk's City Directory
1959	pg. A39	Polk's City Directory
1959	pg. A40	Polk's City Directory
1955	pg. A41	Haines Criss-Cross Directory
1949	pg. A42	Polk's City Directory
1949	pg. A43	Polk's City Directory
1944	pg. A44	Polk's City Directory
1944	pg. A45	Polk's City Directory
1939	pg. A46	Polk's City Directory
1939	pg. A47	Polk's City Directory

City Directory Images

Target Street	Cross Street	Source
✓	-	EDR Digital Archive

CHAVEZ TER 2020

201	CYNTHIA WHITAKER
202	MICHAEL SPANN
	NYKEEM WASHINGTON
203	ALBERTO RAMOS
	JAHMEL OGLETREE
	JENNIFER LOPEZ
	TASHAUNNA COLEMAN
	TSHAUN TURNER
204	SONIA ANDERSON
205	DRE DODD
	FREDDIE DODD
	SAMANTHA KNAUS
206	NATHAN PINEIRO
	TATIANA YOUNG-PINEIRO
207	AZIA AGNEW-EL
	EDGAR CABAN
	NILSA OLIVERAS
	TAMELA BROWNBEY
208	KHADIJA ADAN
211	ANGELA MAULL
	AQUEELAH CURTIS
212	BRITTANY WILLIAMS
	EZEQUIEL MARTINEZ
	LASHONDA ACQUAH
213	CASSANDRA CAMERON
	SHENIQUA WALKER
215	ANTONIO GONZALEZ
	AUDREY BENTON
	TYRELL CANNON
217	DEE BROWN
	HORREK ODOMS
	ISIAH SPANN
218	ADAN KHADIA
219	JENNIFER FLAGG
221	ANA BUENO
	REYNA BURNARD
224	BRITTANY RACHELS
	GLENDA ORTIZ
	LOYDARIS CALDERON
	LOYDARIS CIRINO

Target Street	Cross Street	Source
-	✓	EDR Digital Archive

S STATE ST 2020

117	JAMES B FLECKENSTEIN ATTORNEY
	JAMES FLECKENSTEIN
	RITA LEVINSON
	ZIMMERMAN LAW OFFICES
201	A DIRECT DISH SATELLITE TV
	ALCOHOLICS-NARCOTICS HELPLINE
	BELLAVIA TRANSPORTATION
	GENSON OVERHEAD DOOR INC
	GREAT BARRIER REEF
300	ALEXANDRA COLLINS
	DISABILITY MANAGEMENT SVC
	FRANK A CLARK LAW OFFICE
	GREEN & BRENNECK
	HARTFORD
	HAYLOR FREYER & COON INC
	INSURANCE BROKERS
	KAELEIGH COLLINS
	KEYSTONE PROPERTY TRUST
	KNYCH & WHRITENOUR
	KNYCH & WHRITENOUR LLC
	MARSH
	MONASHEFSKY LAW OFFICES
	MOSAIC FEDERAL AFFAIRS LLC
	OFFICE TEAM
	OLINSKY & DIMARTINO LLP
	PATRICK FLANAGAN
	PORTER J SCOTT ATY
	ROBERT HALF INTL
	SEDGWICK CLAIMS MGMT SVC INC
	TEAM GREEN LAWYERS
	TEAM GREEN LAWYERS PLLC
	US INTERNAL REVENUE SVC
407	NEIGHBORHOOD WATCH-C NEW YORK
	ONONDAGA COUNTY SHERIFF'S OFC
	SYRACUSE CITY POLICE ABUSED
505	DISTRICT ATTORNEYS OFFICE
	HONORABLE JAMES H CECILE
	HONORABLE JOHN J BRUNETTI
	HONORABLE KAREN M UPLINGER
	HONORABLE RORY MC MAHON
	HONORABLE VANESSA E BOGAN
	NEW YORK SMALL CLAIMS
	NEW YORK STATE
	ONONDAGA COUNTY COURT
	ONONDAGA COUNTY DISTRICT ATTY
	ROSENTHAL KATE ROSENTHAL
	SUPREME COURT CLERK'S OFFICE
	SYRACUSE CITY COURTHOUSE
	SYRACUSE CRIMINAL DIV
	SYRACUSE DISTRICT ATTORNEY

Target Street	Cross Street	Source
-	✓	EDR Digital Archive

S STATE ST 2020 (Cont'd)

505	UNIFIED COURT SYST OF NY STATE
511	CITY OF SYRACUSE POLICE DEPT
	COMMUNITY COURT
	HONORABLE JEFFREY R MERRILL
	SYRACUSE CITY MARSHALL
	SYRACUSE CITY POLICE BUDGET
	SYRACUSE CITY POLICE DEPT
	SYRACUSE FIRE DEPT
	SYRACUSE POLICE CRIMINAL DIV
	SYRACUSE POLICE DATA MGMT
	SYRACUSE POLICE DEPT CHIEF
	SYRACUSE POLICE INSPECTION DIV
	SYRACUSE POLICE INTERNAL AFFRS
	SYRACUSE POLICE PERSONNEL DIV
	SYRACUSE POLICE PLANNING DIV
	SYRACUSE POLICE PROPERTY DIV
	SYRACUSE POLICE RECORDERS DEPT
	SYRACUSE POLICE TRAINING DIV
555	BROWN YOLANDA C MSN
	GALLO JR MICHAEL NP
	ONONDAGA COUNTY SHERIFF'S SVC
	ONONDAGA COUNTY YOUTH COURT
	SALOMON ADRIENNE L DO
600	CHILLED WATER & STEAM STATION
	FIFTH JUDICIAL DIST COURT
	JOBS PLUS
	LONG TERM CARE RESOURCE CTR
	MEDICAID
	ONONDAGA COUNTY HOME ENERGY
	ONONDAGA COUNTY SUPPORT CLLCTN
	ONONDAGA COUNTY WELFARE MGMT
	ONONDAGA FACILITIES MGMT DEPT
	STATE NEW YORK
800	CREATIVE FEET LLC
	MULROY CIVIC CTR AT ONCENTER
	NICHOLAS J PIRRO CONVENTION
	ONANDAGA COUNTY CONVENTION CTR
	ONCENTER COMPLEX
	ONCENTER WAR MEMORIAL
	SUBWAY
	SYRACUSE CRUNCH
	SYRACUSE HOCKEY OWNERSHIP TEAM
1106	SYRACUSE FRAME SVC
1110	HOPPS MEMORIAL CME CHURCH
1219	ADRIANNA HAYES
	GALEN HAYES
	SABRINA HAYES
1223	MIRACLE TOWNSEND
1225	JACKELINE RIOS
1226	LOIS'S LOUNGE

S STATE ST 2020 (Cont'd)

1227	FARHIYA OMAR
	REGER OMAR
1229	DONNA MALLORY
	JAMEELAH OXENDINE
1233	ISNINA ABDULLADIR
	LASHAE ODOM
	LINDA ODOM
	TRACY RUMPH
1234	BROTHERLY LOVE CHR-GOD CHRIST
1235	HERIBERTO RIVERA
	MIGUEL RIVERA
1239	JAMES COLEMAN
1249	GRACE HERNANDEZ
	JOAN MARTINEZ
1253	DYNISHA WENTWORTH
1255	CINDYRE FRAZER
	DREVONNA JACKSON
	TAMIKA GRAY
1257	ADEY AHMED
	HUSSEIN SHAMSA
1261	LEON HINKLE
1307	EMMANUEL DUNBAR
	MAEY IBRAHIM
	MARIO JOHNSON
	MARIO KOYROUB
	MOHAMUD SHEIKH
1309	FATUMA HASSAN
	HALIMA ALI
1311	ELIZABETH THOMAS
	LOIS BROWN
	NEA BROOKS
1313	CAROLON DUNLAP
	MOHAMED FARAH
1317	ANTHONY SMITH
	GAWETHONH LAZORE
	JOSEPH POWELL
1319	CARESHA BILLUE
	JAQUAN DENSON
	JESSIE GIFFORD
1327	HAWA ABDI

Target Street	Cross Street	Source
✓	-	Cole Information

CHAVEZ TER 2017

200	MATHIS, OMARI
201	WHITAKER, CYNTHIA
202	CLARK, KIMBERLY
204	ANDERSON, SONIA
205	DODD, FREDERICK
206	YOUNG, KYLE
207	MOHAMED, KHADIJA
208	KHADIJA, ADAM
209	MELENDEZ, CHRISTOPHER
210	DAVIS, WILLIE
211	CURTIS, AQUEELAH M
212	CENTRAL NEW YORK SERVICES HOMESTEAD
	WILLIAMS, BRITTANY
213	CAMERON, CHRISTINA
215	BENTON, AUDREY C
217	HIGHTOWER, ROBIN L
218	HAJI, OMAR
219	FLAGG, JENNIFER D
220	WATSON, MELISSA
221	BURNARD, REYNA
223	CALDERON, KEISHLA
224	CIRINO, LOYDARIS

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 2017

5	SYRACUSE CITY COURT
117	AARON ZIMMERMAN ATTY
	HARLAN LAVINE REAL ESTATE INC
	ZIMMERMAN LAW OFC
201	A DIRECT DISH SATELLITE TV
	ALCOHOLICS & NARCOTICS HELPLINE 24 H
	ASHLAND INC
	B A CONSTRUCTION SERVICES
	BELLAVIA TRANSPORTATION
	DEFENSHIELD INC
	GREAT BARRIER REEF
	IROBOT CORP
	MARTINS GLASS & MIRROR
	VERIZON
300	ALLIANCE BANK
	BRENDAN J REAGAN ATTY
	BRUCE D GROGHAN ATTY
	CENTER FOR COURT INNOVATION
	DISABILITY MANAGEMENT SERVICES
	HARRIS BEACH PLLC
	HISCOCK & BARCLAY
	J SCOTT PORTER ATTY
	JAMES T STOKES ATTY
	KEVIN M HAYDEN ATTY
	KEYSTONE PROPERTY TRUST
	LAW OFFICE OF FRANK A CLARK
	LEIGH A LIEBERMAN ATTY
	MATTHEW E WHRITENOUR ATTYS
	MATTHEW J SKIFF ATTY
	MAXX CORNER DELI
	OLINSKY & DIMARTINO LLP
	PETER W KNYCH ATTY
	ROBERT E PURCELL ATTY
	THE HARTFORD
407	NEIGHBORHOOD WATCH OF CNY INC
511	CITY OF SYRACUSE
	CITY OF SYRACUSE POLICE DEPT
	FIRE DEPARTMENTSYRACUSE CITY
	SYRACUSE P B A
555	TNETIX INC
600	HIV AIDSCOUNSELING & TESTING PROGRA
	LONG TERM CARE RESOURCE CENTER
	MEDICAID
608	CLARK, FRANK A
800	NICHOLAS J PIRRO CONVENTION CENTER A
	SYRACUSE CRUNCH
1106	SYRACUSE FRAME SERVICE INC
1110	HOPPS MEMORIAL C M E CHURCH
1214	OIL BURNER SUPPLY COMPANY
1219	HAYES, SABRINA D

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 2017 (Cont'd)

1223	STITH, CLIFTON A
1224	THOMAS, KIMBERLY M
1225	RIOS, JACKELINE
1226	LOISS LOUNGE
1231	MUSA, MADINA
1233	BOYER, JOHNNA
1234	BROTHERLY LOVE CHURCH OF GOD IN CHRI
1249	RIVERA, JOSHUA
1253	WENTWORTH, DYNISHA L
1255	GRAY, TAMIKA B
1257	ABTIOW, HESTHER
1261	HINKLE, LEON
1300	JIMMYS SUPER SAVER INC
1311	BURNETT, TERRY D
1313	FARAH, MOHAMED
1323	PARKER, ANGELA
1327	ABDI, HUSSEIN

Target Street	Cross Street	Source
✓	-	Cole Information

CHAVEZ TER 2014

200	CRAWFORD, ZAKYAH
201	MORALES, DELORES J
202	SPANN, MICHAEL
204	ANDERSON, SONIA
205	ADAMS, CANDACE
	BRITT, CLEMENT
	TAYLOR, ANDREA D
206	OCCUPANT UNKNOWN,
207	HAWAILE, SHEIKNOOR
209	MELENDEZ, PEDRO
210	DREHER, SREKEISHA
211	CURTIS, AQUEELAH M
212	CENTRAL NEW YORK SERVICES HOMESTEAD
213	CAMERON, CHRISTINA
214	OCCUPANT UNKNOWN,
215	BENTON, AUDREY C
216	HAMLET, GARRY
217	HIGHTOWER, ROBIN L
218	HAJI, OMAR
219	ZORRILLA, ROBERTO
220	OCCUPANT UNKNOWN,
221	DELACRUZ, REYNA
222	OCCUPANT UNKNOWN,
223	OCCUPANT UNKNOWN,
224	ESPARZA, GLENDA

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 2014

5	SYRACUSE CITY COURT
117	FLECKENSTEIN JAMES B ATTY
	HARLAN LAVINE REAL ESTATE INCORPORAT
	ZIMMERMAN AARON ATTORNEY
201	A DIRECT DISH SATELLITE TV
	ALCOHOLICS & NARCOTICS HELPLINE 24 H
	BROADBAND INTERNET ACCESS
	CABLE INTERNET ACCESS PROVIDER
	CHARITY BAPTIST CHURCH
	DISH NETWORK
	GREAT BARRIER REEF
	MARTINS GLASS & MIRROR
	MATTHEW JAGODZINSKI
300	ALLIANCE BANK
	AMERICAN LANDMARK PROPERTIES
	CENTER FOR COURT INNOVATION
	CNY FINANCIAL GROUP
	DISABILITY MANAGEMENT SERVICES
	HARRIS BEACH PLLC
	HAYDEN KEVIN M ATTY
	HISCOCK & BARCLAY
	KEYSTONE PROPERTY TRUST
	LAW OFFICE OF FRANK A CLARK
	LIEBERMAN LEIGH A ATTY
	METRO GRILL & CATERING
	OLINSKY & DIMARTINO LLP
	PORTER J SCOTT ATTY
	PURCELL ROBERT E ATTY
	ROSENHOLM STEPHEN R
	SEDGWICK CLAIMS MANAGEMENT SERVICES
	SKIFF MATTHEW J ATTY
	STOKES & KNYCH LLC ATTYS
407	NEIGHBORHOOD WATCH OF CNY INCORPORAT
505	COUNTY OF ONONDAGA
	MERRILL JEFFREY R HON SUPERVISING
	ROSENTHAL KATE HON
	UPLINGER KAREN M HON
511	CITY OF SYRACUSE
	FIRE DEPARTMENT SYRACUSE CITY
	NEW YORK STATE
	STATE OF NEW YORK
	SYRACUSE P B A
555	COUNTY OF ONONDAGA
	TNETIX INC
600	COUNTY OF ONONDAGA
	HIV AIDS COUNSELING & TESTING PROGRA
	MEDICAID
601	COUNTY OF ONONDAGA
606	OCCUPANT UNKNOWN,
608	CLARK, FRANK A

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 2014 (Cont'd)

800	COUNTY OF ONONDAGA
	NICHOLAS J PIRRO CONVENTION CENTER A
	ONCENTER COMPLEX
	SYRACUSE CRUNCH
1106	SYRACUSE FRAME SERVICE INCORPORATED
1110	HOPPS MEMORIAL CME CHURCH
1113	PLEMING, JACQUELINE
1214	OIL BURNER SUPPLY COMPANY
1219	HAYES, SABRINA D
1223	STITH, CLIFTON A
1224	BROOKS, AMEKECO S
	GRANT, JAMANI
	THOMAS, KIMBERLY M
1225	RIOS, JACKELINE
1227	HAMPTON, ARKIMA
1229	COLLINS, E
1231	MUSA, MADINA
1233	ADEN, ALI
1234	BROTHERLY LOVE CHURCH OF GOD IN CHRI
1235	TESTMAN, TERESA
1239	MCMULLEN, BRITTANIE L
1249	RUIZ, CHRISTOPHER
1253	WENTWORTH, DYNISHA L
1255	GRAY, TAMIKA B
1257	OCCUPANT UNKNOWN,
1261	BALLARD, LAKEISHA
1307	SHEIKH, MAHAMUD
1309	ALI, HALIMA
1311	BURNETT, MARY B
1313	FARAH, MOHAMED
	HASSAN, LII
	JACKSON, BAMBI
1315	GALBET, AWEYS
1317	LICEA, REYNALDO
1323	EUSON, ALLEN
	MASON, ALTON
	PARKER, DONNA J
	TRYON, VANESSA
1327	ABDI, HUSSEIN

Target Street	Cross Street	Source
✓	-	Cole Information

CHAVEZ TER 2010

200	CRAWFORD, ZAKYAH
201	MORALES, DELORES J
202	HUDGINS, NYRI D
203	TURNER, TSHAUN
204	MIMS, VERNELL
205	ADAMS, CANDACE
	BRITT, CLEMENT
	TAYLOR, ANDREA
206	BROWN, JENNIFER
207	BROWNBEY, TAMELA
208	GREEN, ELLIOT
209	MELENDEZ, PEDRO
210	OCCUPANT UNKNOWN,
211	DURHAM, CURTIS
212	COCKRELL, BECKY
213	YOUNG, LATOYA
214	HUNTER, AMBER L
215	STEWART, L
216	HAMLET, GARRY
217	JOHNSON, KILSHAWN
218	DAVIS, BETTY A
219	ZORRILLA, ROBERTO
220	HOLBDY, ASHLEY
221	BURNARD, REYNA
222	JAMES, PATRICK
223	OCCUPANT UNKNOWN,
224	NOBLE, YVETTE

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 2010

117	FLECKENSTEIN JAMES B
	HARLAN LA VINE REAL ESTATE INC
	ZIMMERMAN LAW OFFICES
201	A DIRECT DISH SATELLITE TV
	ALCOHOLICS & NARCOTICS
	BROADVIEW NETWORKS INC
	DSL NET
	GRIDNET INTERNATIONAL INC
300	ALLIANCE BANK
	ALLIANCE BANK NA
	AMERICAN LANDMARK PROPERTIES
	BRICKWEDDE LAW FIRM
	BRICKWEDDE, RICHARD
	DISABILITY MANAGEMENT SVC
	FRANK A CLARK LAW OFFICE
	FRENCH ALCOTT PLLC
	GABOR & MONASHEFSKY
	HARRIS BEACH
	HARRIS BEACH PLLC
	HARTFORD
	HISCOCK & BARCLAY
	HISCOCK & BARCLAY LLP
	IBM
	KEYSTONE PROPERTY TRUST
	KNYCH & WHRITENOUR
	KPMG
	MARSH & MERCER
	MARTY, FREDERICK W
	METRO GRILLE
	OLINSKY & SHURTLIFF
	PORTER J SCOTT
	PORTER, J
	RITZ ROBERT G
	ROSE & JORDAN LAW OFFICES
	STOKES & KNYCH LLC
407	NEIGHBORHOOD WATCHC NEW YORK
	ONONDAGA COUNTY SHERIFF
	SYRACUSE CITY POLICE ABUSED
505	HONORABLE ANTHONY F ALOI
	HONORABLE JAMES H CECILE
	HONORABLE JOHN J BRUNETTI
	HONORABLE JOSEPH E FAHEY
	HONORABLE KAREN M UPLINGER
	HONORABLE KATE ROSENTHAL
	HONORABLE LANGSTON C MC KINNEY
	HONORABLE STEPHEN J DOUGHERTY
	HONORABLE THOMAS W HIGGINS JR
	HONORABLE VANESSA E BOGAN
	HONORABLE WILLIAM D WALSH
	NEW YORK CRIMINAL DIV

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 2010 (Cont'd)

505	NEW YORK SMALL CLAIMS
	NEW YORK TRAFFIC DIV
	OFFICEDISTRICT ATTORNEY
	ONONDAGA COUNTY DISTRICT ATTY
	SYRACUSE CITY COURT
	SYRACUSE CRIMINAL DIV
	SYRACUSE DISTRICT ATTORNEY
	VICTIMWITNESS ASSISTANCE CTR
511	COURT REPORTERS
	HONORABLE JEFFREY R MERRILL
	HONORABLE KEVIN G YOUNG
	SYRACUSE CITY MARSHALL
	SYRACUSE CITY POLICE ACCIDENT
	SYRACUSE CITY POLICE BUDGET
	SYRACUSE CITY POLICE DEPT
	SYRACUSE FIRE DEPT
	SYRACUSE FIRE PREVENTION
	SYRACUSE POLICE CRIMINAL DIV
	SYRACUSE POLICE DATA MGMT
	SYRACUSE POLICE DEPT CHIEF
	SYRACUSE POLICE INSPECTION DIV
	SYRACUSE POLICE INTERNAL AFFRS
	SYRACUSE POLICE PERSONNEL DIV
	SYRACUSE POLICE PLANNING DIV
	SYRACUSE POLICE PROPERTY DIV
	SYRACUSE POLICE RECORDS DIV
	SYRACUSE POLICE RECRUITMENT
	SYRACUSE POLICE TRAINING DIV
555	COUNTY OF ONONDAGA
	ONONDAGA COUNTY SHERIFFS SVC
	ONONDAGA COUNTY YOUTH COURT
	SPRINGSTON MARY E
	T NETIX
600	COURTS ADMINISTRATION
	DIRECTOR OF CHILD SUPPORT
	EMPLOYMENTSELF SUFFICIENCY
	FIFTH JUDICIAL DISTRICT COURT
	ONONDAGA COUNTY HOME ENERGY
	ONONDAGA COUNTY SOCIAL SVC
	ONONDAGA COUNTY SUPPORT CLLCTN
	ONONDAGA COUNTY WELFARE MGMT
	ONONDAGA FACILITIES MGMT DEPT
	POTTER, ANTHONY F
601	CHILLED WATER & STEAM STATION
800	CIVIC CENTER THEATER
	MULROY CIVIC CTR AT ON CTR
	SYRACUSE CRUNCH HOCKEY CLUB
1106	SYRACUSE FRAME SVC INC
1110	HOPPS MEMORIAL CME CHURCH
1113	PLEMING, JACQUELINE

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 2010 (Cont'd)

1208	RICHARDSON, KEVIN
1214	OIL BURNER SUPPLY CO INC
1223	TOWNSEND, JAMES O
1224	BROOKS, AMEKECO S
	GRANT, JAIMYA A
	THOMAS, KIMBERLY M
1225	SANTIAGO, VENUS
1226	LOISS LOUNGE
1227	HISCOCK, KELLY M
1229	COLLINS, ETRENDIA
1231	XIONG, HLEE
1233	ADEN, ALI
1234	BROTHERLY LOVE COGIC
1235	OCCUPANT UNKNOWN,
1239	OCCUPANT UNKNOWN,
1249	GLOVER, CLARENCE
1253	WENTWORTH, DYNISHA
1255	LEON, NICIMPAYE
1257	AHMED, ADEY
1261	OCCUPANT UNKNOWN,
1300	JIMMYS SUPER SAVER INC
1307	SHEIKH, MAHAMUD
1309	ALI, HALIMA
1311	BURNETT, CHARRES
1313	FARAH, MOHAMED
	JACKSON, LYNN
1315	GALBET, AWEYS
1317	EASTMAN, DANNIELLE
1323	HORNER, DARLENE
	MASON, ALTON
	NIETO, CARMEN
	TRYON, VANESSA
1327	GRAVES, TYESHEKA

Target Street	Cross Street	Source
✓	-	Cole Information

CHAVEZ TER 2005

200	STATER, ANTHONY
201	MORALES, DELORES J
202	GOVAN, LAVERNE
203	OGLETREE, JAHMEL
204	DUFFUS, JOSETTA
205	BRITT, CLEMENT
	TAYLOR, ANDREA
207	CABAN, EDGAR
208	CLARK, RANDALL
210	OCCUPANT UNKNOWN,
211	MAULL, ANGELA
212	SHANDAS NAILS
	SHONDAS HAIR SALON
213	WALKER, SHENIQUA
214	POWERS, MELISSA A
215	JUSTINIANO, ANTONIO
216	OCCUPANT UNKNOWN,
217	HIGHTOWER, ROBIN L
219	BUTLER, FREDDIE
220	OCCUPANT UNKNOWN,
221	VELEZ, JESSE I
222	GARCIA, HECTOR
223	OCCUPANT UNKNOWN,
224	BRINONES, ALBERTO

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 2005

117	FLECKENSTEIN JAMES B
	PIRAINO ANDREW N
	ZIMMERMAN LAW OFFICE
123	ALEXANDER, THARON K
201	A T T
	VERIZON
300	ALLIANCE BANK
	ALLIANCE LEASING INC
	AMERICAN GENERAL LIFE INSURANCE CO O
	CHENANGO AMBULANCE SERVICES INC
	DISABILITY MANAGEMENT SERVICE
	FIRST ALBANY CORP
	GABOR AND MONASHEFSKY
	HADERSKI, STEPHEN J
	HARLAND SIMON CONTROL SYSTEMS
	HARTFORD INSURANCE GROUP
	IBM CORP
	INSURANCE BROKERS
	KPMG LLP
	MAGGIES
	MARSH
	MARTIN MARTIN & WOODARD
	PORTER, J
	ROBINSON COMPUT
	SCICCHITANO FRAPESCHI PINSKY PLLC
	SCICCHITANO, GREGORY
	STOKES & KNYCH LLC
	TROP, JOHN
	URRUTIA, JULIO E
	WACHOVIA SECURITIES
	WEST LEYDON VOLUNTEER AMBULANCE CO I
407	COUNTY OF ONONDAGA SHERIFF S HEADQ
	NEIGHBORHOOD WATCH CNY
	ONONDAGA SHERIFFS OFC PISTOL LICENCE
	SHERIFFS OFFICE
	SHERIFFS OFFICE DARE PROGRAM
505	DISTRICT ATTORNEY OFFICE
	JAMES H CECILE
511	CITY OF SYRACUSE POLICE DEPARTMENT
	NEW YORK CRIMINAL DIVISION
555	NEW JUSTICE SERVICES
	ONONDAGA CO
	ONONDAGA COUNTY SHERIFFS DEPARTMENT
	THE JUSTICE CENTER
600	ADMINISTRATIVE JUDGES OFFICE
	COLAGIOVANNI, MICHAEL
	DEPARTMENT FACILITIES MANAGEMENT
	HIGHTOWER, ROBIN H
	JAMES F WILCOX CONSTRUCTION
	PASCARELLA, R A

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 2005 (Cont'd)

600	POTTER, ANTHONY F
	RICHARDSON, SHAWN R
	RYDER, JESSE
	THE FIFTH JUDICIAL DIST OFFICE
	WINSTON, KEVIN
608	FRANK A CLARK LAW
800	ONCENTER COMPLEX
	SYRACUSE HOCKEY OWNERSHIP
1106	SYRACUSE FRAME SERVICE INC
1208	MIMS, K
1219	STROMAN, DAISY
1224	THOMAS, BARBARA J
1225	JERNIGAN, HORACE
1227	DANIELS, S
1229	HERNANDEZ, TRACIE C
1233	GRANT, NICOLE D
1234	BROTHERLY LOVE CHURCH OF GOD CHRIST
	HUMANITARIAN ORGANIZATION
1235	RIVERA, EVELYN
1239	KEARSE, ANNE
1249	GLOVER, CLARENCE
1255	FRAZER, CINDYRE G
1257	MIMS, RASHIDA
1261	OCCUPANT UNKNOWN,
1307	TOWNLEY, PAMELA
1309	WASHINGTON, BERNARD B
1311	BURNETT, C
1313	OCCUPANT UNKNOWN,
1315	RUSSELL, BEVERLY L
1317	OCCUPANT UNKNOWN,
1319	GIFFORD, JESSIE M
1323	NIETO, CARMEN
1327	GRAVES, TYESHEKA
	MORALES ANTONIO

Target Street	Cross Street	Source
✓	-	Cole Information

CHAVEZ TER 2000

200	JOHNSON, RICHARD T
201	MORALES, DELORES
202	OCCUPANT UNKNOWN,
203	ANDREWS, C
207	GILES, MICHAEL
208	OCCUPANT UNKNOWN,
209	JOE, T
211	OCCUPANT UNKNOWN,
214	OCCUPANT UNKNOWN,
215	JUSTINIANO, ANTONIO
216	TURNER, C
218	OCCUPANT UNKNOWN,
219	STACKHOUSE, A L
220	CUEVAS, LETICIA
221	VELEZ, JESSE J
224	LEBBY, RITA

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 2000

117	FLECKENSTEIN JAMES B ATTORNEY
	ZIMMERMAN LAW OFFICE
300	AMERICAN GENERAL LIFE INSURANCE CO OF NEW YORK
	AMERICAN GENERAL LIFE INSURANCE COMPANY OF NEW YORK
	BERSANI, RICHARD A
	BRIDGETS CAFE & DELI
	HARTFORD THE
	HARTFORD THE WORKERS COMPENSATION CLAIMS
	J & H MARSH & MCLENNAN
	J & H MARSH MCLENNAN
	J&H MARSH & MCLENNAN
	ONE PARK PLACE
410	LIVINGSTON, MARY R
503	OCCUPANT UNKNOWN,
511	CITY OF SYRACUSE TRAFFIC BUREAU
	FIRE DEPARTMENT SYRACUSE CI
	HERKIMER COUNTY OF FIRE DEPARTMENTS
	KILGORE, KARIN M
	NEW YORK STATE COURTS
	ONEIDA COUNTY OF DISTRICT ATTORNEY
	ONEIDA COUNTY OF FIRE
	ONONDAGA COUNTY OF DISTRICT ATTORNEY
	SYRACUSE CITY OF FINANCE CITY HALL
	SYRACUSE CITY OF FIRE
	SYRACUSE CITY OF POLICE DEPARTMENT
	SYRACUSE FIRE DEPARTMENT
	SYRACUSE POLICE DEPARTMENT
555	ALEXANDER, ROBERT J
	BELL, CORNELL N
	BULLOCK, PHILLIP
	BURTIS, EDWIN
	EVANS, SAMUEL L
	GOSLEE, TIMOTHY J
	HARRIS, DEURICE D
	HILTS, RANDY
	KELLY, MICHAEL
	KNEESKERN, DANIEL L
	MCGOWAN, OMAR
	MOORE, THOMAS L
	MOTHERSELL, ROBERT M
	WHITEHEAD, EDWARD
600	LUHR, JOHN H
	ONEIDA COUNTY OF SOCIAL SERVICES
	ONONDAGA COUNTY OF
	ONONDAGA COUNTY OF MEDICAL SYSTEMS UNIT
	ONONDAGA COUNTY OF SOCIAL SVCES DEPARTMENT
700	FORENSIC CONSULTANTS LIMITED CENTER FOR HUMAN SERVICES
711	GHALY HODA
800	AMERICAN BOWLING CONGRESS THE
	FINE HOST CORPORATION ONCENTER

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 2000 (Cont'd)

800 ONCENTER
912 BAHN CYNTHIA L MSW
OCCUPANT UNKNOWN,
1105 SAVLATION ARMY THE ADULT REHABILITATION CENTER
1110 HOPPS MEMORIAL C M E CHURCH
1208 TIBBS, VALERIE
1219 STROMAN, GEORGE
1223 OCCUPANT UNKNOWN,
1224 THOMAS, CHRIS
1227 CLINCH, SUE A
1231 OCCUPANT UNKNOWN,
1233 GOODE, KIM
1234 HUMANITARIAN ORGANIZATION FOR MULTICULTURAL EXPERIENCES INCO
HUMANITARIAN ORGN FOR MULTICULTURAL EXPERIENCES I
1235 OCCUPANT UNKNOWN,
1239 OCCUPANT UNKNOWN,
1241 OCCUPANT UNKNOWN,
1243 OCCUPANT UNKNOWN,
1253 RATCLIFF, SHIRLEY J
1300 JIMMYS SUPER SAVER
1309 WASHINGTON, ANGELA
1311 OCCUPANT UNKNOWN,
1313 DUNLAP, CAROLYN R
1315 RUSSELL, B
1317 RUSH, Z
1319 GIFFORD, JESSIE
1321 OCCUPANT UNKNOWN,
1323 PETERSON, DEBRA

Target Street	Cross Street	Source
✓	-	Cole Information

CHAVEZ TER 1995

200	WHITE, JOHN
208	TEARNEY, MARLANA
211	COOPER, ROBERT JR
220	HARPER, LORENE

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 1995

1	FLECKENSTEIN, JAMES B, ATTY
	HARLAN LA VINE REAL ESTATE INC
117	LA VINE HARLAN REAL ESTATE INC
	NEW LIFE ADOPTION AGENCY INC
	PIRAINO, ANDREW N, ATTY
	ZIMMERMAN LAW OFC
	ZIMMERMAN, AARON MARK, ATTY
	ZIMMERMAN, GOLDA, ATTY
201	FUJITSU NETWORK SWITCHING
300	AMERICAN GENERAL LIFE INSURANCE CO OF NEW YORK
	AMERICAN GENERAL LIFE INSURANCE CO OF NEW YORK-HOME OFFICE
	AMERICAN INTERNATIONAL GROUP
	CITIBANK NEW YORK STATE-SYRACUSE
	IBM CORP
	LANGAN, ARTHUR G
	MARSH & MCLENNAN INCORPORATED
	PIONEER DEVELOPMENT CO
	TREATS N TREASURES
	XRISTOU'S CAFE & DELI
511	FIRE DEPARTMENT/SYRACUSE CITY-CHIEF'S OFFICE
	ONONDAGA COUNTY OF-DISTRICT ATTORNEY-VICTIM-WITNESS ASSISTAN
	SYRACUSE CITY OF-FIRE-CHIEFF
	SYRACUSE CITY OF-FIRE-PREVENTIONN
	SYRACUSE P B A
555	BLACK CREEK INTEGRATED SYSTEM
	MORRISON-KNUDSEN/HUEBER-BREUER CO
600	ONONDAGA COUNTY OF HEALTH DEPT LABORATORY ENVIRONMENTAL TOXI
	ONONDAGA COUNTY OF-DEPT OF FACILITIES MANAGEMENT-COMMISSIONE
	ONONDAGA COUNTY OF-SOCIAL SERVICES DEPT-CHILD SUPPORT ENFORC
	ONONDAGA COUNTY OF-SOCIAL SERVICES DEPT-DIRECTOR OF CHILD SU
	ONONDAGA COUNTY OF-SOCIAL SERVICES DEPT-MEDICAID DIVISIONN
	ONONDAGA COUNTY OF-SOCIAL SERVICES DEPT-RESOURCE UNITT
	ONONDAGA COUNTY OF-SOCIAL SERVICES DEPT-SYSTEMS/PLANNING/RES
601	ONONDAGA COUNTY OF-DEPT OF FACILITIES MANAGEMENT-CHILLED WAT
800	FINE HOST CORP, ONCENTER
	ONCENTER
901	WILLIAMS, D
903	AUSTIN, JAMES
	SMITH, PHILLIP
	WRIGHT, VONYEE
909	MURDENT, DON
911	ASKEW, L
	SMITH, ROBIN A
919	COMER, M
921	HIGHTOWER, R
	PARKS, VERDELL
923	PERKINS, A
1105	SALVATION ARMY THE-ADULT REHABILITATION CENTER
	SALVATION ARMY THE-STORES-NUMBER 1
	SALVATION ARMY THE-TRUCK CALLS

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 1995 (Cont'd)

1105	SALVATION ARMY THE-TRUCK PICK-UP SVCE
	SALVATION ARMY-CALLS FOR TRUCK
	SALVATION ARMY-TRUCK PICK-UP SVCE
	STEINER, FRED
1106	SYRACUSE FRAME SVCE INC
1110	HOPPS MEMORIAL C M E CHURCH
	HOPPS MEMORIAL C M E CHURCH-PUBLIC TELEPHONE
1208	WILSON, RENEE
1214	OIL BURNER SUPL CO INC
	OIL BURNER SUPL CO INC-BOOKKEEPING DEPT
1223	STROMAN, GEORGE, SR
1224	THOMAS, C
1226	LOIS' LOUNGE
1231	JOHNSON, BARBARA
1234	BROTHERLY, LOVE CHURCH OF GOD IN CHRIST
1241	GIFFORD, JESSE
1243	BAKER, LUCINDA
1247	RUSMAR ENVIRONMENTAL CORP
1253	RATCLIFF, S J
1300	JIMMY'S SUPER SAVER
1301	GUNN, MARY
1313	PETERSON, DEBRA
1317	FORD, G
1321	PARKER, F

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 1992

115	MURBRO PARKING INC-S STATE & E WATER LOT
117	AARON MARK ZIMMERMAN LAW OFCS
	LA VINE HARLAN REAL ESTATE INC
	NYS ASSEMBLY MEMBERS-MINORITY LEADER CLARENCE RAPPLEYEA REGI
	PIRAINO, ANDREW N, ATTY
	RAPPLEYEA, CLARENCE D, JR, ASSEMBLY MINORITY LEADER
	ZIMMERMAN LAW OFC
	ZIMMERMAN, AARON MARK, ATTY
	ZIMMERMAN, GOLDA, ATTY
201	CHUBB LIFEAMERICA
300	AMERICAN GENERAL LIFE INSURANCE CO OF NEW YORK
	AMERICAN GENERAL LIFE INSURANCE CO OF NEW YORK-HOME OFFICE
	AMERICAN INTERNATIONAL GROUP
	BELLA'S NEWS
	HOME LIFE INSURANCE CO OF NEW YORK
	LANGAN, ARTHUR G
	MARSH & MCLENNAN INCORPORATED
	PIONEER GROUP THE-ONE PARK PLACE
	UPSTATE PROFESSIONAL PLANNING SVCE
	XRISTOU'S CAFE & DELI
511	FIRE DEPT-CITY TO REPORT A FIRE CHIEF'S OFC
	NORTH GARAGE
	ONONDAGA COUNTY OF-DISTRICT ATTORNEY-VICTIM-WITNESS ASSISTAN
	SERVICE AMERICA
	SYRACUSE CITY OF-FIRE-CHIEF
	SYRACUSE CITY OF-FIRE-PREVENTION
	SYRACUSE FIRE DEPT
	SYRACUSE P B A
600	ONONDAGA COUNTY OF-CIVIL SERVICE PERSONNEL & EXAMINATION INF
	ONONDAGA COUNTY OF-DEPT OF FACILITIES MANAGEMENT-MAINTENANCE
	ONONDAGA COUNTY OF-SOCIAL SERVICES DEPT-CHILD SUPPORT ENFORC
	ONONDAGA COUNTY OF-SOCIAL SERVICES DEPT-LEGAL DIVISION-RESOU
	ONONDAGA COUNTY OF-SOCIAL SERVICES DEPT-MEDICAID DIVISION
	ONONDAGA COUNTY OF-SOCIAL SERVICES DEPT-STAFF DEVELOPMENT &
	ONONDAGA COUNTY OF-SOCIAL SERVICES DEPT-SYSTEMS/PLANNING/RES
601	BARRY BETTE & LED DUKE INC
	ONONDAGA COUNTY OF-DEPT OF FACILITIES MANAGEMENT-CHILLED WAT
800	ONONDAGA COUNTY OF CONVENTION CENTER
	ONONDAGA COUNTY OF ON CENTER
903	AUSTIN, JAMES
	SMITH, PHILLIP
	WRIGHT, VONYEE
905	JACKSON, LULA
907	CARTER, JANNIE
	WADE, T
911	ASKEW, L
	GRANT, HOLLYE
913	BRYAN, C
915	SMALLS, ANGELA
917	BACON, C

Target Street	Cross Street	Source
-	✓	Cole Information

S STATE ST 1992 (Cont'd)

917	LOPEZ, RAPHAEL
919	COMER, M
921	HIGHTOWER, R
	PARKS, VERDELL
923	ISLAM, ETHELEAN
	LEE, JAMES B
	PERKINS, A
	TURNER, L
1105	SALVATION ARMY THE TRUCK PICK UP SVCE
	SALVATION ARMY THE-ADULT REHABILITATION CENTER
	SALVATION ARMY THE-STORES-NUMBER 1
	SALVATION ARMY THE-TRUCK CALLS
	SALVATION ARMY THE-TRUCK PICK-UP SVCE
	SALVATION ARMY-TRUCK PICK-UP SVCE
	STEINER, FRED
1106	SYRACUSE FRAME SVCE INC
1110	HOPPS MEMORIAL C M E CHURCH
	HOPPS MEMORIAL C M E CHURCH-PUBLIC TELEPHONE
1208	MC ARTHUR, MARK
1214	OIL BURNER SUPL CO INC
	OIL BURNER SUPL CO INC-BOOKKEEPING DEPT
1226	LOIS' LOUNGE
1233	PERRY, M
1234	BROTHERLY, LOVE CHURCH OF GOD IN CHRIST
1241	GIFFORD, JESSE
1300	JIMMY'S SUPER SAVER
1301	GUNN, MARY
1303	DAYS, B
1311	THOMAS, ELIZABETH
1319	WEST, NEDRA
1321	WILLIAMS, ALFONSO

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1988

Floors & Rooms
Bsmt Maintenance Dept 425-2199
100 County Department Bldg & Grounds 425-3451
105 County Dept Of Personnel 425-3537
2d Fl County Dept Social Serv 425-2560
3d Fl Dept Of Social Services (Medicaid Div) 425-2928
4th Fl Dept Social Servs 425-3526
4th Fl Planning & Research Div Dept Social Servs 425-2348
5th Fl Dept Social Servs Fair Hearing Div 425-2973
5th Fl Dept Social Servs A P Eiu 4-A Unit
5th Fl Dept Social Servs Resource Div 425-2219
6th Fl County Probation Intake Dept (Overflow) 425-2286
700 Dept Health Food Control Div 425-3256
8th Fl County Dept Health 425-2256
720 County War Memorial rear ent

69

HARRISON ST INTERSECTS
811 War Memorial Parking Lot
E ADAMS ST INTERSECTS
900 City Of Syracuse Fire Station No 1 473-5495
901a Apartments
1 Vacant
917 Syracuse Housing Authority (Under Constn)
NEW ST ENDS

21

EAST TAYLOR INTERSECTS
CONRAIL OVERPASSES
1105 Salvation Army (Men's Social Service Dept) 475-9983
1106 Syracuse Frame Service Inc auto body repr 476-7974
1108 Hoppes Memorial Church 478-0191
1109 Salvation Army (Stge)
1112 Vacant
★Lockett Kimberly 423-9758
1114 Bullitt Hattie Mrs 476-6059
Kirkland Hattie Mae Mrs 476-1513
1115 Salvation Army Thrift Store No 1 475-9983
1116 Vacant
BURT INTERSECTS
1200 Tip-Top Barber Shop 476-6452
1208 Vacant
Field Pearl M Mrs ◎ 476-6149

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1983

HARRISON ST INTERSECTS
811 War Memorial Parking Lot
E ADAMS ST INTERSECTS
900 City Of Syracuse Fire Station No 1
901a Apartments
1 Vacant
2 Laundry Room
3★Thompson April
4★Fields Ilitha
5★Warner Eliz
6 Vacant
7★Delee Mary
8 Dorn Annie 424-1151
9★Jones Rosie
10 Works Linda
901b Apartments
1★Reeves Tyrone 472-5883
2 Vacant
3★Sullivan Monroe
4 Vacant
7★Murray Angela
8 Vernon B
9★Ballard Nellie
10 Bush Dorothy B 422-3296
901c Apartments
1 Vacant
2 Vacant
3 Merriweather Marlene
4★Avent Shirley
5 Harvey Cathy
6 Vacant
7★Caldwell Betty
8★Mc Gloun Gladys
9★Spann Deann
10 Blackwell Jo Ann
903a Apartments
1 Vacant
2 Underdue Lillian
3 Durham Thelma
iv 4 Shields Earline
903b Daniels Evelyn 471-8028
903c Apartments
1 Carther Janice
2 Boiler Rm
3★Waring Hill
4 Mc Cullough Rosa
5 903d Gray Georgia
903e Apartments

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1983

1 Vacant
2 Vacant
3 Campany Phyllis
4 Seals Thos
903f Vacant
905a Seals Blonerie 476-0136
905b Apartments
1 Vacant
2★Suber Michl
3★Wright Dianne
4★Flanagan Fannie M 476-8534
905c Suber Eugene
905d Apartments
1 Vacant
2★Nickens Marvin
3 Vacant
4★Shaw Linda 422-9325
5 Davis Willie Mae
6 Vacant
905e Apartments
1 Vacant
2 Elliott John
3★Floyd Brenda
4 Vacant
5★Reese Lillian
6★Wright Lonnie
905f Robinson Cord
905g Apartments
1★Kirby Freddie Mae
2 Vacant
3★Mc Arthur Justine
4★Kellan Minnie 425-7880
905h★Rahman Hafeethah 475-6778
907a Apartments
1★Griffin James 475-0795
2★Sampson Jakki 425-9027
3 Vacant
4 Vacant
5 Vacant
6★Williams Evelyn
7★Brooks Deborah
8 Williams Linda
9★Jackson Cassandra
10 Vacant
907b Apartments
1 Edwards Mary M 472-0870
2 Lndry Rm
3 Vacant
4 Kelly Vernella
5★Graves Lucy Mae
6 Williams Margt 476-6046
7★Hudoleston Geneva
8 Vacant
9 Vacant
10★Griffin Jimmie
907c Apartments
1 Vacant
907d Apartments
1 Vacant
2 Vacant
3★Yancy Novelette
4 Vacant
5★Mack Mattie 479-9602
6 Brooks Robt L 424-0135
7 Johnson Doris M 422-7439
8★Kellam Tina 425-7880
9 James Bianco
10 Vacant
909a Apartments
1 Daniels Robt
2 Vacant
909b Apartments
1 Vacant
5 Vacant
6★Edwards Karin
909c Apartments
1 Vacant
2 Brown Ethel
3 Vacant
4★Scrivens Leonard
5 Vacant
6★Arrington James
911a Apartments
1 Cotton Gwendolyn
2 Vacant
911b Apartments
1 Vacant
2 Vacant

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1983

S STATE ST—Contd
3★Gray Mannie
4 Utter Edna
5 Vacant
6 Vacant
911c Apartments
1★Fielder John
2 Perry Joe 471-3522
3 Vacant
6 Vacant
915a Apartments
1 Vacant
2 Vacant
3★Jenkins Annetta
4 Guins Julya 476-4561
915b Hawkins Laura M
915c Apartments
1 Boiler Room
2 Vacant
3 Grant Vernell
4★Weatherspoon Shirley
915d★Mc Laurin Curtis
915e Apartments
1 Laundry Rm
2★Sheppard Ruth
3★Adams Paula
4 Stroman Hazel
915f★Williams Juanita
917 Mulberry Square Rental Office 479-9731
NEW ST ENDS
919a Apartments
1 Vacant
2 Shoulders Mane 478-5214
3★Green Nathl 478-5314
4 Cruz Raphael 424-9470
919b Apartments
1 Vacant
2★Parsons Michl 422-4883
3★Cotton Walter
4 Gray Mary
5 Vacant
6 Vacant
919c Apartments
1★Connors Christine E 478-8953
2★Brantley Betty
3★Mc Cullough John
4 Felton Uneeda
5 Vacant
6★Ketter Lucille
921a Apartments
1 Vacant
4 Vacant
921b Apartments
1★Cross Bosco 476-7055
2 Vacant
921c Apartments
1 Vacant
923a Apartments
1★Gray Eddie 471-0727
2 Vacant
3★Carter Frances
4★Whitehurst Martha 474-8700
923b Humphrey Geo
923c Apartments
1 Vacant
2 Boiler Rm
3 Vacant
4 Preaster Martha Mrs 476-1870
923d Goddard Gwendolyn 471-1053
923e Apartments
1 Vacant
2 Vacant
3 Hamlett Britistine
4★Germany Sylvia
1★Lawson Rose 422-6278
925a Vacant
925b Apartments
1 Vacant
3★Smith Betty
4★Maddox Grace
1 Vacant
925d Apartments
1 Vacant
3★Lamey Lincoln
4 Vacant
925e Apartments
1 Vacant
4★Driver Clarence
5 Vacant
6 Vacant
925f★Thomas Marcella
925g Apartments
1 Vacant
2 Williams Denise
3 Vacant
4 Porter Barbara 475-5165
925h★Flowers Margie

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1977

E ADAMS ST INTERSECTS
900 City Of Syracuse Fire Station No 1
901a Apartments
1★Jones Lucinda 475-5721
2 Boiler Room
3 Knight Willie O
4★Oliff Eva
5★Lockett Rayford 471-2295
6 Johnson Brenda C 476-0229
7★Hawkins Johnny 422-7954
8 Dorn Annie 424-1151
9 No Return
10★Bootright Willie
901b Apartments
2 Vacant
3★Wynn Marylin
4★Turner Sherry
5★Epps Detra
6★Ellen Geo 471-3062
7★Perry Rick
8★Blake Arth
9★Hollis Robt 425-8080
10 Vacant
901c Apartments
1★Green Hattie
2★Brently Willie
4 Rice Josephine
5★Gregory Betty 471-1500
6★Kellam Minnie
7 Mays Shirley
8★Danzy Joyce
9 Vacant
10 Vacant
903a Apartments
1★Hoyle Linda
2★Underdue Lillian
3 Pugh James
4 Griffin Edmund 422-4401
903b★Daniels Evelyn 471-8028
903c Apartments
1★Carther Janice
2 Boiler Rm
3 Mc Neill Lorraine 471-2745
4 Brooks Rose Marie
903d Henderson Linda 471-4028
903e Apartments
1 Millicent
2★Hoosock Ruth 425-9253
3 Brunson Eva
4 Hicks Betty
903f★Brooks Sharon
905a Seals
905b Apartments
1★Green Christine
2★Knapp Wm
3 Jones Paul
4 Flahagan Fannie
905c★Suber Eugene
905d Apartments
1★Davis Lilly
2 Vacant
3★Stultz Anne 472-7602
4★Wallace Willie
5★Williams Evelyn
6 Lane Arth 422-2452
905e Apartments
1 Vacant
2 Boiler Rm
3 Frazier Alex L 472-5705
4★Birden Richd 424-0641
5★Thomas Juner L
6 Seibert Charlotte
905f Post Roslyn
905g Apartments
1 Vacant
3 Collier Joann
4 Hicks Wm H 476-2418
905h Benjamin Anthony

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1977

907a Apartments
1 Vacant
5 Gipson Geraldine
6 Brown Joe
7 Heyward Frances
8★Maeweather Henry
9★Sampson Jacquelin 425-1888
10 Sarkodie Mensha 472-4107
907b Apartments
1★Ward Denise
2 Lndry Rm
3 Frazier Evelyn
4 Vacant
5 Spencer Wanda
6★Brown Kath
7★Fireson Ida Mae
8 Brown Glenn 476-0633
9 Marshall Judy 474-3069
10 Gifondorwa Danl S 476-5914
907c Apartments
1★Bryant Brenda
2 Vacant
3 Sanford Geneva
4★Butcher Bobby
5 Brooks Mattie 471-8428
6 Vacant
7★Smith Bruce
8 Kirby Darlene 476-7888
9 Barnett Gene G 476-7582
10 Scott Connie 471-0258
907d Apartments
1 Vacant
2 Vacant
3★Shaw Erick
4 Robinson Cora
5 Vacant
6 Brooks Robt 475-1998
7★Johnson Dora M
8★Reid Grady
9★Grady Louise
10 Gregory Nellie 476-1296
909a Apartments
1★Daniels Robt
2★Horsey Marilyn
3★Myers Pamela
4 Suressi Barbara
909b Apartments
1★Thrasher Robt
2 Jackson Lessie B 478-0165
3 Lane Carolyn 476-4711
4 Jacob Victoria
5 Vandermark Robt
6★Crawford Jean
909c Apartments
1 Thomas Mollie
2 Papachan Kunjamma
3★Freeman Brenda
4★Sora Waring
5★Kondapi Sharon
6★Ketter Lucille
911a Apartments
1 Blandon Ted
2 Vacant
3★Mac Thomas Rosa
4 Vacant
911b Apartments
1 Perez Domingo
2★Armstad Ida
3★Stepen John
4 Utter Edna
5★Preston Eliz
6 Mattis Robt Jr 476-3978
911c Apartments
1 Logan Gail 471-3381
2★Ford Yvonne
3★Beasock James
4★Heath Richd
5★Thorton Roy
6★Flynn Evelyn
915a Apartments
1★Sonick Mokenzie
2★Stokes Vicky
3★Humphrey Minnie 422-5941
4 Guins Alice 476-4561
915b Hawkins Laura Mrs 472-3645
915c Apartments
1 Boiler Room
2 Vacant

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1977

S STATE ST—Contd
3 Grant Vernell
4 Reed Yolanda
915d Wrabek John J 476-1907
915e Apartments
1 Laundry Rm
2★Clyde Randal
3 Ross Barbara T 471-7499
4 Stroman Hazel
915f Peays V 476-3824
917 Mulberry Square Rental Office 479-9731
NEW ST ENDS
919a Apartments
1★Nichoels Stanley
2★Carny Bessie
3★Rudsell James
4★Cruz Raphael
919b Apartments
1★Vorkey T M 475-1475
2 Robinson Rosemarie 422-5684
3 Koshy Annamma
4★Herrod X-Mas
5★Jackson Marion
6 Ogletree Lawrence
919c Apartments
1 Conner Christine E 478-8953
2 Alexander
3 Vacant
4★Washington Betty J 471-7499
5★Baums Theo
6★Lawrence Ricardo 422-4071
921a Apartments
1★Royster Arth
2★Pearl Patterson
3 Vacant
921b Apartments
1 Vacant
2★Hoyle Victor
3★Ronlhac Theresa
4 Boatwright Willie
5★Rawls Bobby 474-8605
6 Bryant Thos L 423-0857
921c Apartments
1 Santangelo Joseph 422-4464
2★Earle Lee 478-5210
5★Earl Roberta
4★Brown James H 476-4312
5★Akear Clarence
6 Connelly Hugh F Jr 476-7352
923a Apartments
1★Sand Eula
2★Parker Deborah
3 Vacant
4 Carter Frances 476-4945
923b Humphrey Geo
923c Apartments
1 Vacant
2 Boiler Rm
3 Johnson Eva Mae
4 Preaster Obedie 476-1870
923d Goddard Gwendolyn
923e Apartments
1 Vacant
2 Lndry Rm
3★Hamlett Britistine
4 Dickerson Theresa I
923f Slaughter Margt
925a Battle Beverly 422-3308
925b Apartments
1 Vacant
3 Smith Betty
4 Warner Inez
1★Thomas Mary
925d Apartments
1 Vacant
3★Middlebrooks Lynnice
4★Madufokwa Johnny
5 Woods Charles H Jr 476-2558
6★Johnson Rita
925e Apartments
1★Glenn Monica
2★Driver Clarence
3 Bandoh King
4★Mitchell Dorms
5★Spaun Gloria
6★Phelps Valerie
925f★Harison Johnny
925g Apartments

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1972

E ADAMS ST INTERSECTS

901a Apartments

1 Long Steph B 478-5348
2 Lndry Rm
3 Alsko C M 479-5733
4 Ellis Joann
5 Curry Robt
6 Vacant
7 Scott Richd 474-5448
8 Gladden Ralph 474-2269
9 Bornhard Keith E 479-9063
10 Gladden Garnell 475-7548

901b Apartments

1 Vacant
2 Vacant
3 Lipson Edw H 478-2613
4 Vacant
5 Hodges Charles 478-1265
6 Mc Millian Post
7 Nolan Paul
8 Wallace Watson 474-0696
9 Watanabe Danl H 478-6548
10 Arandia Hernando Y 478-3466

901c Apartments

1 Graves Richd C 472-2366
2 Saleem Sasduddeen M 479-9125
3 Gavarasana Subhadra
4 Colman Barry E 479-9304
5 Le Flore James E 474-6250
6 Brothers Richd
7 Salis Harry A 472-8041

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1972

8 Pride Stevenson 476-9396
9 Ford Ruth E 475-1969
10 Morse Lana
903a Apartments
1 Collington David C 478-3377
2 Vacant
3 Owens Leo
4 Gregoire J Peter 478-7373
903b Averett Thos
903c Apartments
1 Miller Rosa
2 Barber Gretchen 474-0467
3 Dixon Robt E 474-1179
4 Harvey Sammie B 474-0652
903d Cooper Clyde Jr 476-3379
903e Apartments
1 Spivey Maggie 478-2579
2 Surace Sandra 478-4326
Baney Robt L 472-6856
4 La Change Susan M Mrs 476-5492
903f Gruman Fred
905a Garvey Yolanda 475-9616
905b Apartments
1 Pritchard Kent
2 Perry Leslie 478-2914
3 Regoster Brown
4 Nemier Laura
905c Vacant
905d Apartments
1 Cadel Wm A 478-3275
2 Vacant
3 Chang Yaw-Pan 475-3426
4 Brown Mary E 475-5690
5 Vasquez John A 472-4217
6 Shepard Jeannie 475-3853
905e Apartments
1 Haft Diane
2 Boiler Rm
3 Payne Russell
4 Sylock Norman
5 Vogelbecker John J 475-0898
6 Seibert Charlotte
905f Escobar Guillermo
905g Apartments
1 Mc Millon Rufus 472-2146
2 Gamer Anthony
3 Cole Wm S 464-2503
4 Frank Roswell
905h Benjamin Anthony
907a Apartments
1 Vacant
2 Vacant
3 Needleman Jack 478-0843
4 Kreinheder Gary
5 Hightower Jerry J 478-7633
6 Bellinger Mark F 475-1054
7 Sciscioli Vito J 472-7966
8 Ito Kiyohiko 478-1925
9 Raym John E
10 Caleb Dwen
907b Apartments
1 String D
2 Lndry Rm
3 Frazier Evelyn
4 Kennedy Kathleen 476-2496
5 Vacant
6 Vacant
7 Costanzo Richd M 476-8071
8 Vacant
9 Green Raymond H 476-0524
10 Nightingale Richd
907c Apartments
1 Vacant
2 Vlapimer Gerald
3 Troxel Patricia
4 Temple Helena
5 Vacant
6 Jones Eliz B 476-1063
7 Troiano Raymond G 472-9797
8 Vacant
9 Leonard Moira N 476-1442
10 Schildhais Solomon 476-1060
907d Apartments
1 Delacey John C 476-0923
2 Blake Barry 478-0274
3 Kitos Robt J 475-6227
4 Velarde Francisco
5 Butler Lawrence

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1972

S STATE ST—Contd
6 Brooks Robt 475-1998
7 Rasken Robt J 476-1721
8 Vacant
9 Patterson Harry W 475-7834
10 Pape Robt G 478-4862
909 Apartments
1 Habeeb Mohamed 472-2819
2 Friedman Peter A 479-6444
3 Fox John
4 Vacant
1 Bulova John 479-9560
A2 Jackson Lessie B 478-0165
3 Benson Michl W 472-2330
4 Glaser Lawrence 472-0861
5 Vacant
6 Bourne Walter D 478-2644
1 Millard Alex J 472-7341
2 Duberman Susan 476-3653
3 Lockwood Arth 476-6257
4 Swain Andrew 475-6202
5 Bych Saml
6 Galied Ali
911a Apartments
1 Wang Kim
2 Clough John 479-8219
3 Alfonso Arth
4 Jones Mildred J 472-0270
911b Apartments
1 Verma H
2 Murray James H 478-5344
3 Brand Stuart O 474-1456
4 Dukell Steven S 476-6318
5 Kulish Helen 475-6204
6 Lind Harry
911c Apartments
1 Goodall Edwin B 479-6027
2 Tang Chunc-Liang
3 Vacant
4 Jeffery Alice E 476-6069
5 Vacant
6 Schiller John 475-4854
915a Apartments
1 Dawson Wendell
2 Vacant
3 Huddleston Paul 475-4841
4 Barras Marjorie 475-7483
915b Hawkins Laura Mrs 472-3645
915c Apartments
1 Boiler Room
2 Dunn David
3 Grant Vernell
4 Kirby Fredk Mae Mrs 472-2277
915d Wrabek John J 476-1907
915e Apartments
1 Vacant
2 Lane Arth
3 Guins Alicia 476-4561
4 Wintree Betty
915f Perry Patricia
917 Mulberry Square Rental Office 479-9731
NEW ST BEGINS
919a Apartments
1 Beikecki Charles
2 Vacant
3 Harbison Warren 479-7785
4 Ciambra Virginia 472-7668
919b Apartments
1 Vacant
2 Vacant
3 Dowling Wm F 475-1127
4 Young Audrey M
5 Yun Myung S Mrs 475-7959
6 Huber Gayle 475-6255
919c Apartments
1 Cole Marion L 479-8470
2 Kasputis David A 475-1818
3 Ely John 472-6171
4 Silverman Robt
5 Chicco Patricia A 474-0540
6 Woodiel Laura 472-4261
921a Apartments
1 D'Arms Phillip 472-1716
2 Vacant
3 Davis David
4 Bruce Barbara L 472-6055
921b Apartments
1 Bryant Joyce H 472-8133

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1968

720 COUNTY WAR MEMORIAL REAR ENT

134

---HARRISON INTERSECTS
---EAST ADAMS INTERSECTS

69

---JACKSON INTERSECTS
---E TAYLOR INTERSECTS

21

---EAST TAYLOR INTERSECTS
---E L & W RR INTERSECTS
1105 SALVATION ARMY MEN'S SOCIAL SERVICE DEPT GR5-9983
1106 SYRACUSE FRAME SERVICE INC GR6-7974

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1964

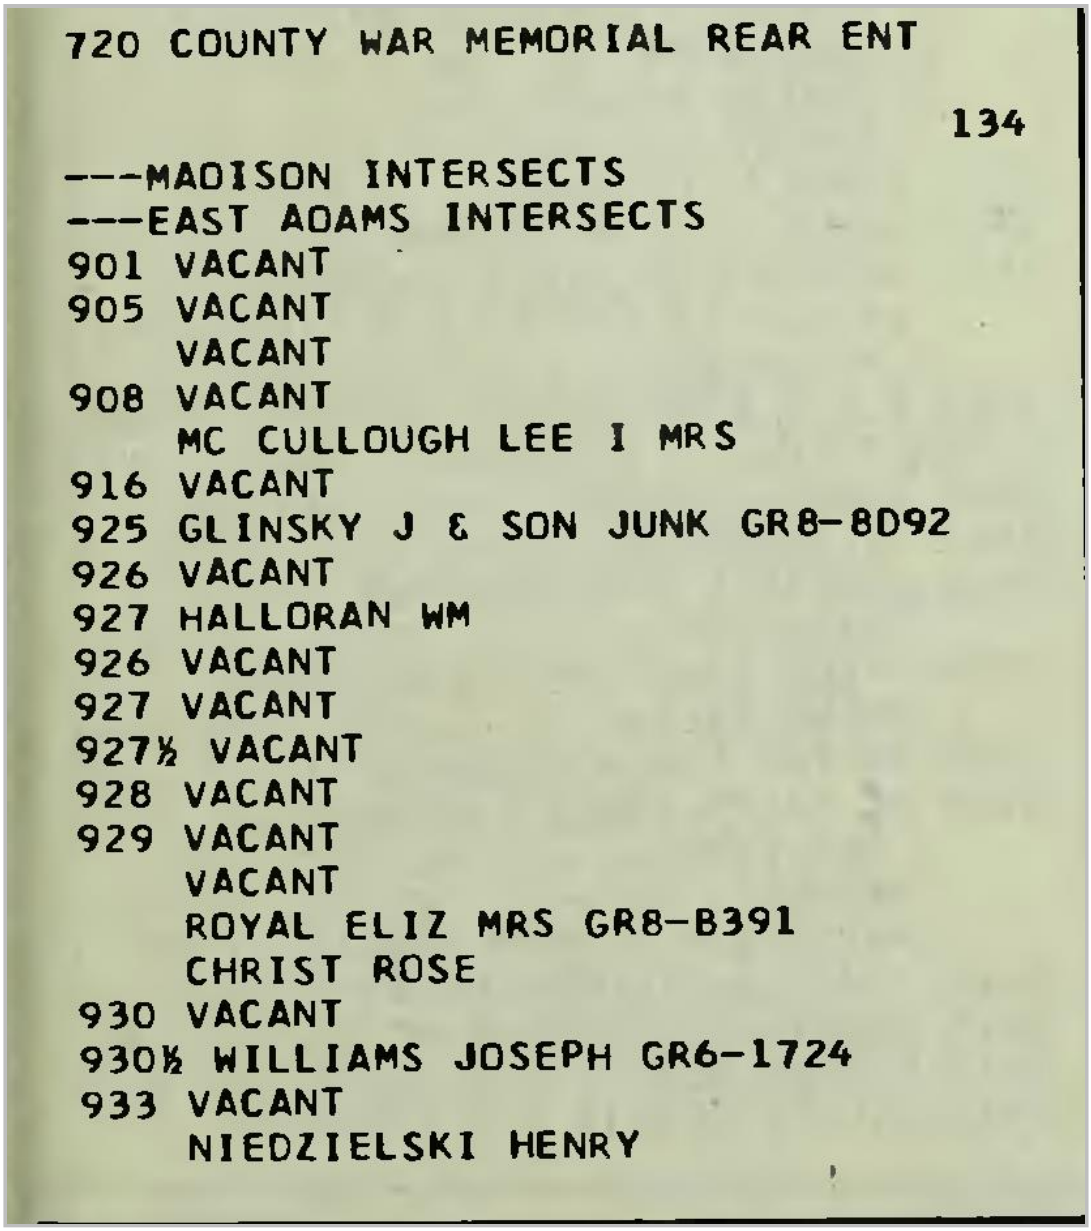

720 COUNTY WAR MEMORIAL REAR ENT

134

---MADISON INTERSECTS
---EAST ADAMS INTERSECTS
901 VACANT
905 VACANT
VACANT
908 VACANT
MC CULLOUGH LEE I MRS
916 VACANT
925 GLINSKY J & SON JUNK GR8-8D92
926 VACANT
927 HALLORAN WM
926 VACANT
927 VACANT
927½ VACANT
928 VACANT
929 VACANT
VACANT
ROYAL ELIZ MRS GR8-B391
CHRIST ROSE
930 VACANT
930½ WILLIAMS JOSEPH GR6-1724
933 VACANT
NIEDZIELSKI HENRY

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1964

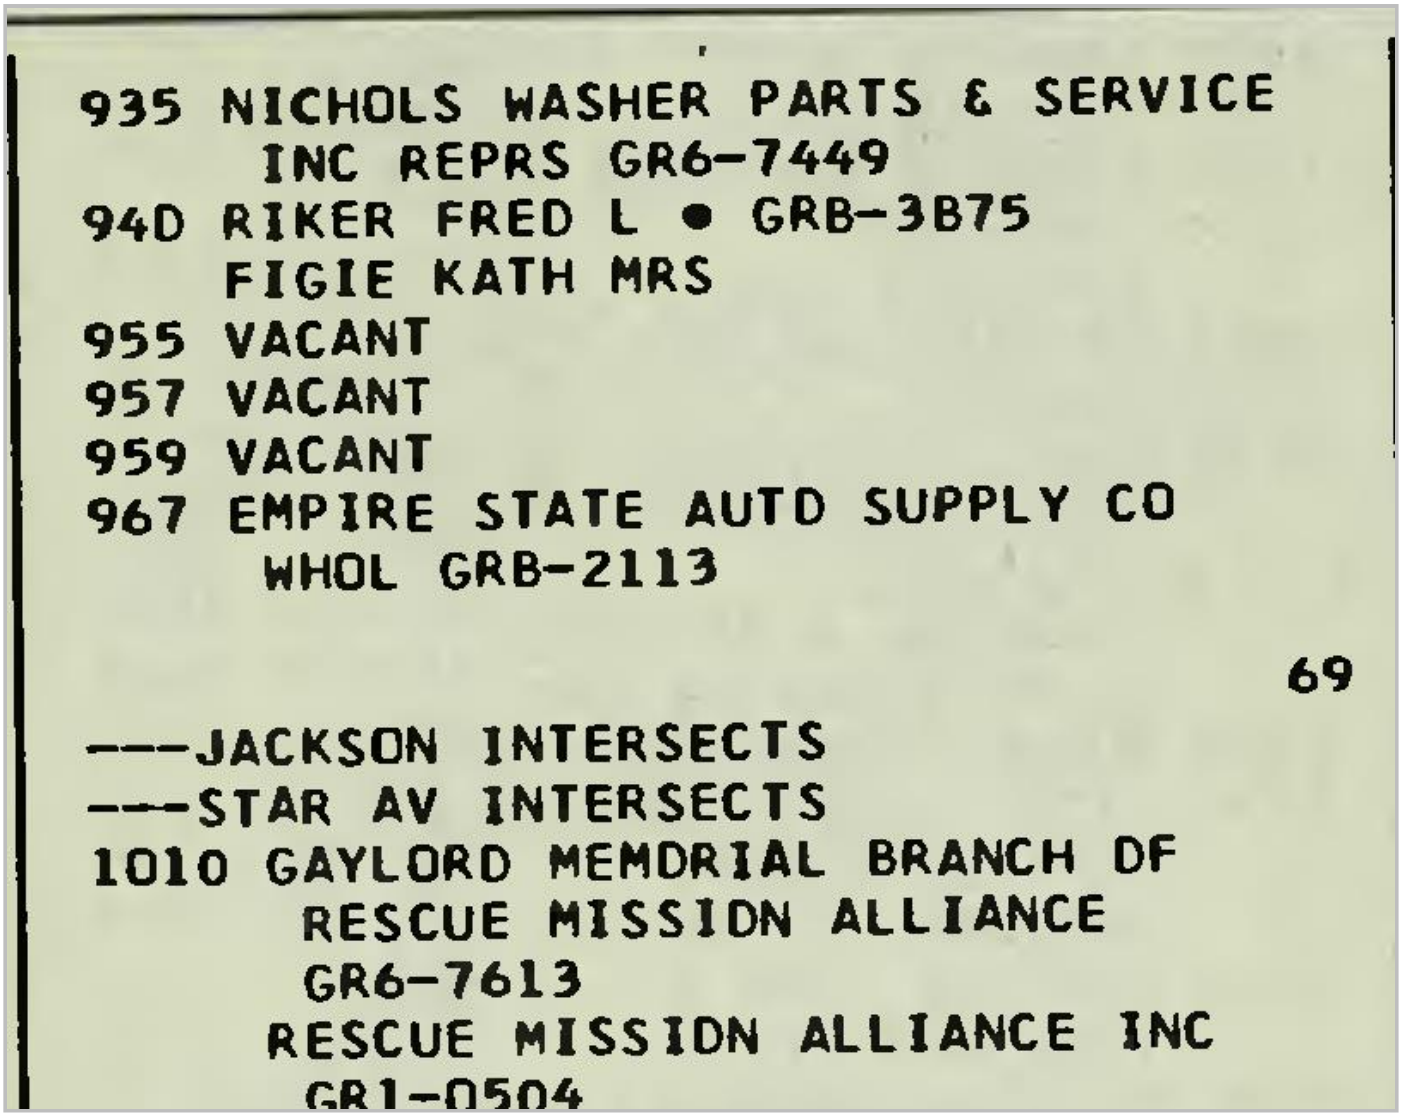

935 NICHOLS WASHER PARTS & SERVICE
INC REPRS GR6-7449
940 RIKER FRED L ● GRB-3B75
FIGIE KATH MRS
955 VACANT
957 VACANT
959 VACANT
967 EMPIRE STATE AUTD SUPPLY CO
WHOL GRB-2113

69

---JACKSON INTERSECTS
---STAR AV INTERSECTS
1010 GAYLORD MEMDRIAL BRANCH DF
RESCUE MISSIDN ALLIANCE
GR6-7613
RESCUE MISSIDN ALLIANCE INC
GR1-0504

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1959

835 Mancini Andrew Foods ΔGR1-9090
Mantell Earl 2 ΔHA2-4775
Collins Lawrence E 2

E Adams st crosses

21

901 Meltzer's Auto Supply Co Inc ΔGR6-7976
905 Vacant 1
Vacant 2
Vacant 3
906 Tartaro Anthony J trucking serv
Briggs Lawrence 2 ΔGR6-2568
Canery Luther F Rev 3 ΔGR6-8949
908 Mitchell Donald 1 © ΔGR6-6093
Williams Dotsie Mrs 2 ΔGR6-7193
909 Tecler Morris used furn ΔHA2-6271
910 Reaves Alphonsa ΔGR6-2792
912 Mathews Andrew J ΔGR6-9697
913 Storage
Rosenthal M Toy Co Inc ΔGR2-0734
914½ Martin Leonard ΔHA2-5077
916 Syracuse Frame Serv auto repr ΔGR1-8922
925 Glinsky J & Son junk dlrs ΔGR2-8931
926 Silver Jos cigar fcty 1
Curcie Geo 1
Williams John 2
927 Swiderski Stanley 1
Taylor Chas D 2
927½ Kappesser Lulu A Mrs 1
928 Williams Arnold 1
Dorsey Lee 2
Vacant 2
929 McCord John F 1 ΔGR6-9701
Lewis Norman M 2 ΔGR6-3767
Crary Kenneth H 1 ΔGR8-5793
Christ Rose 2
930 Slater Hildegarde Mrs 1 © ΔGR8-0632
Crayton Lettie 2
McCreary Jas 2
930½ Jackson LeRoy 1
Vacant 2
931 McCloskey Chas C 1 ΔGR6-3707
Ivorra Miguel 2 ΔGR1-2692
931½ Mattice Wm O ΔGR8-1154
932 Fassett Leland 1
Januszka Frank S 2 ΔHA2-2410
933 Haley Rose V 1 ΔGR6-9460
Migdal Cath Mrs ΔGR2-8143
Meade Clyde E 2 ΔGR1-6003
Stevens Agnes Mrs 2
935 Nichols Sales & Serv ΔHA2-4710
936 Youker Emil 1 ΔGR5-7477
Niedzielski Henry 2
Mullett Bertha Mrs 2
937 Mancini Rose Mrs 1 ΔHA2-3284
Henderson Jos 2 ΔGR5-2704
937½ Whaley Henry B 1 ΔGR1-5618
938 Defeo Motors used cars
939 Allied Decoration Display Co ΔGR1-0363

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1959

SOUTH STATE ST—Contd

940 West Clinton S 1
Riker Fred L 1 ◎ △GR8-3875
Figie Kath Mrs 2
942 Aikens Virgil D 2
943 Shaver Willie J 1
943 Merritt Jimmie R 1
Meyers Victor 2
McGriff Willie F 2 △HA2-2885
944 Warren Fredk B 1
944½ Gaynor Mary C Mrs 1
947 Robinson Frank E 1 ◎ △GR8-8382
Williams Harry 2 △GR6-0258
948 Firestone Tire & Rubber Co
△GR1-8336
949 Todzia Frank 1
Stacy Bertha Mrs 2
951 Elliott Marion Mrs 1
Wheeler Fred 1
Vacant 2
953 Sydman Maude M Mrs 1
Mandigo Albert C 1 △GR8-2280
Smith Goldie Mrs 2
Young Mary C 2
954 May Thos 1 △GR8-5757
Davis Danl 1
Ohman Fredk A 2
Byrd Edw R 2
955 Morrissey John trucking △GR6-4592
957 Tanner Sam B 1 △GR1-1455
Jones Edgar 2 △GR6-6235
959 Baunee Chimney Serv △GR8-2968
960 Lemon Sanders 1 △GR1-6221
Stanton Keith 1 △GR1-5459
Phillips Lee D 2
Owens Dannie J 2
962 Kinsey Emry 1
Newvine Hobart R 1
Reisman Irving J 2 ◎ △HA2-6331
Yager Kath E Mrs 2 △HA2-4504
rear Reisman Irving J tinsmith
964 Berman's Restr △GR6-8942
967 Empire State Auto Supply Co whol
△GR8-2113
968 Dewey O L Co Inc whol paper prods
△GR6-0588
Brooks Edw A 2 △GR6-6914
Brooks Edw H 2
972 Rosenberg's Pharmacy △GR6-5162

Jackson st crosses

1000 Gorkin Harry gas sta and auto repr
△GR8-9025
1001 Cavallos Restr ◎ △GR8-9338
1003 Storage

Target Street	Cross Street	Source
-	✓	Haines Criss-Cross Directory

S STATE ST 1955

835	*MANCINI ANDRW FOODS	39090
901	*MELTZERS AUTO SUPL	29061
901	*MELTZER BEN	29061
905	CLARKE JOSEPH H	28894
906	CHRISTENAT G B	21977
906	*GARELICK LOUIS	20708
906	*GARRS LUGGAGE MFG	20708
908	MITCHELL DONALD	23555
909	*TECLERS FURN STORE	26271
912	MATHEWS ANDREW J	25335
913	*ROSENTHAL M TOY CO	20734
913	*FIRE DEPT ENG CO 16	31823
916	*SYR FRAME SVCE	38922
918	*COUSES WELDERY	23373
925	*GLINSKY JOSEPH&SON	28931
927	WELLS HELEN MRS	20648
927½	WELLS NELLIE MRS	29379
929	HERAPTHA JNO	29048
929	LAVINE BEN	26523
929	MCCORD JOHN F	29756
930	TURNER ESSIE REE	37609
930	SLATER LEDGER MRS	26956
930½	WILLIAMS DOTSIE MRS	23673
931	EVORRA MICHL	32692
931	MCCLOSKEY CHAS C	23371
931½	MCCARTHY JERRYJ	27582
932	JANUSZKA FRANK S	22410
932	MIGDAL JOSEPH	30986
933	HALEY ANTHONY J	29576
937	GODIN GEO F	38489
937	HOLMES J B	38682
937	MANCINI ROSE MRS	23284
937½	GWILT JESSEI MRS	35780
937½	SPORE AGNES MRS	23354
939	*HAYMAN HYMAN	36001
939	*HAYMANS USED CAR	36001
940	RIKER FRED	24689
941	CLARK FRED E	33392
941	RODRIGUES PAULINE	23365
941½	*EASTERN MERCANTILE	34400
942	BATES GEO F	25878
943	WILSON JAS G	35817
943	WILSON WALTENA MISS	29569
947	ROBINSON ANNA MRS	36858
947	WILLIAMS HARRY	31874
948	*FIRESTONE APL SV	29743
948	*FIRESTONE TIRE&RBR	29743
948	*FIRESTONE TIRE&RBR	38336
949½	DESIMONE ERNEST JR	32322
951	CARTER ALLIE MRS	22461
951½	ELLIOTT MARION MRS	31561
953	MORRISSEY JNO	22726
954	MAY THOS	31749
954	DAVIS DANL R	34815
957	VELASCO JNO	29711
959½	MCKEE MARIA MRS	31468
960	STANTON KEITH	35459
960	BURKE JAS W	35476
962	DEMMERLE RICHD J	30486
962	*REISMAN IRVING	26331
964	*BERMANS RSTRNT	28623
964	*BERMANS RSTRNT	39494
967	*MANCINIS SUPR MKT	22811
968	*AJAX HOME EQUIPT	22529
972	ROSENBERG JACOB	35509
972	METZ H GEO	35509
972	*ROSENBERG PHARMACY	35509
972	*ROSENBERG PHARMACY	49144
1000	*GORKINS SERV STATIO	39824

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1949

835 Standard Food Market gro —1
Mantell Carl—2
E Adams st crosses
901 Meltzer's Auto Supply Co Inc
902 Bee Hive Auto Store auto supplies
Rothman Alan—2
904½ McCarthy Wm
905 Prashaw Hattie Mrs—1
Casey Terrance—2
Garrow Alex—3
906 Roscoe Grocery
Fineberg Annie Mrs—2 ◎
Christenat Geo—3
908 Mitchell Donald—1
Moore Mack—2
909 Tecler Morris furn
910 Henry Jas
912 Opalka John
913 Hook & Ladder No 4
Engine No 16
913½ Syracuse Food Distributing Co
914 DeShane Francis—2
914½ Salatto Anthony ◎
915 Dewey O L Co mfr agt
Gulf Specialty Sales sponges
Syracuse Sales Book Co
916 A & J Garage auto repr
918 Marino Jos gro
Monica Fred E—2
rear Couse's Weldery welding
918½ Verdone Frank ◎
919½ Bribre Marion Mrs—1
Gardner Wm—1
Zimmer Lavina Mrs—2
Frances Walter—2
921 Dixie Jos—1
922 Berry Leroy W
923 Vacant
924 Revette Mary—1
Mandigo Albert C—1
Gowan David N—2
925 Glinsky J & Son junk
926 David's Electrical Repair Shop
Vacant—1
Prosky Cath Mrs—2
Belair Gordon J—2
927 Chappell Jos L—1
Dick John—1
Matchuk Mary Mrs—2
928 Montondo Wm J—1
Dorsey Lee—2
929 Lavine Ben—1
McCord John F—1
Lewis Norman—2
Brown Peter—2
930 Slater Ledger—1
Brothers Booker T—2
Jones Arth—2
930½ Simmons Eric trucking h—1
Smith Eloise Mrs—2
931 McCloskey Chas C—1
Santacroce Pasquale—2
Bush Geo—2
931½ Ivorra Miguel
932 Migdal Jos—1
Mullett Elsie Mrs—1
Forgette Wilfred J—2
Stein Racchel
rear Delaney Alex
933 Haley Anna M—1 ◎
Migdal Cath Mrs
Glennon Lillian Mrs—2
Washivick Walter
934 Temple Chas

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1949

936 Bahe Margt Mrs—1
Pettit Lela Mrs—1
Niedzielski Henry—2
Mullett Saml—2
937 Mancini Andrew—1
Perolla Anthony—2
937½ Spore Arth—1
Haynes Cath Mrs—2
938 Gaynor Mary C ◎
939 Hayman's Used Car Co
940 Riker Fred L variety h—1
Sprague Ernest E—2
Pfeiffer Philip—2
941 Sawyer Herbert H—1
Clarke Frances Mrs—1
Roderick Pauline Mrs—2
rear Emery Arth
942 Bates Geo F—2
943 Hudspeth Edw—1
Hester Mack
Sparks Edw—2
Porter Harry A—2
944 Myers Robt C—1
944½ Newson Raymond C—1
947 Robinson Frank E—1 ◎
Williams Harry—2
948 Firestone Tire & Rubber Co
Firestone Appliance Service Shops
949 Ermakovitz Nicholas—1
Halleck Walter R—2
951 Elliott Marion Mrs—1
Lawyer Danl—2
953 Morrisey John trucking h—1
Medler Jas E—1
Lane Thos—2
Garfield Eliz Mrs—2
954 May Thos—1
Singleton Anthony—1
Ohman Fredk A—2
Davis Danl—2
955 Wychules Eva H Mrs
956 Barker Chas
957 Borreggine Dominick—1
Koss Saml—2
958 Battle Clarence
959½ McKee Earl
960 Burke Claude—1
Stanton Keith—2
Burke Jas W—2
Seals Anna M Mrs
962 Stewart Wiley D—1
Sullivan Chas—1
Reisman Irving J—2
964 Berman's Restaurant
965 Vacant—2
967 Mancini Jos gro
968 State Auto Supply & Appliance Co
970 Roberts Cora J Mrs—2
Antis Lawrence D—2
Yackel Kenneth—2
972 Rosenberg's Pharmacy
Jackson st crosses
1000 Gorkin Harry gas sta and auto repr

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1944

835 Behn Sol gro
Mantell Earl

E Adams st crosses

901 Meltzer's Auto Supply Co
902 Bee Hive Auto Store auto supplies
Saul Louis—2
904 Hobart Roy R
905 Vacant
906 Fineberg Annie Mrs ◎
Abdo Nicholas—3
907 Teckler Nathan furn
908 Spraker Wm F—1
Brand Augusta E—2 ◎
909 Teeler Morris furn
909½ Vacant—1-2
910 Curran Anna Mrs
911 Vacant
912 Vacant
913 Hook & Ladder No 4
Engine No 16
914 Vacant—1-2
915 Eagle Rock Wool Insulation Co
916 Vacant
918 Marino Joseph gro
Vacant—2
918½ Verdone Frank ◎
919 Vacant
919½ Berg Chas E—1
VanValkenburgh Willis E—2
Burdich Emma Mrs—2
921 Johnson Dorothy Mrs—1
Auringer Andrew H—2

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1944

922 Travers Leah G
923 Edwards Mitchell—1
LaFleur Jas F—2
924 Barlow Angelina Mrs—1
Gowan David N—2
rear Mandigo Albert C
925 Glinsky J & Son junk
926 Vacant store
Prosky Catherine Mrs—1
Doyle Patk J—1
Belair Gordon J—2
Martin Pauline I Mrs—2
927 Troendle Conrad—1
Watson Bernard J—1
Matchuk Mary Mrs—2
928 Montondo Wm J—1
Tate Wm M—2
929 Lavine Ben—1
McCord John F—2
930 Smith Louis H—1
West Aug F—2
Cooper Henrietta Mrs
931 McCloskey Chas C—1
Winslow Wm A—2
931½ Miller Clifford A
932 Smith Gilbert W—1
Migdal Jos
Mills Robt—2
Clark Mary Mrs
933 Haley Anna M—1 ◎
Migdal Catherine Mrs
Glennon Lillian Mrs—2
Washivick Walter
934 Hayden Mabel
936 Chatfield Cora Mrs—1
Wilkinson Wm A—1
Lyman Clarence F—2
Mullett Bertha M Mrs
937 Handelman Rose hairdrsr
Mancini Andrew—1
Handelman Leah Mrs—2
rear Berry Howard A—1
Smith Jas H—2 ◎
938 Gaynor Mary C gro h ◎
939 Hayman's Used Car Co
940 Vacant store
Parks Elmer E—1
Januszka Frank S—2
Melvin Virginia J Mrs
941 Sawyer Herbert H—1
Clark Edwd
Claver Blanche Mrs—2
rear Emery Arthur
942 Bates Geo F—2 ◎
943 Ermakovitz Julia Mrs—1
Adams Louis
Carpenter Anna Mrs—2
Wood John J
944 Myers Robt C—1
Lampson Gertrude J Mrs
947 Lavine Herman—1 ◎
Williams Harry H—2
948 Firestone Tire & Rubber Co
949 Mancini Frank—1
Molosky Michl—2
951 Wheeler Jennie M Mrs—1
Smith Ralph E—1
Russell Sonny—2
953 Bowers Walter O—1
VanValkenburg Fletcher C—1
Takes Jas—2
Medler Jas—2
954 Loucks Iva M Mrs—1
Singleton Anthony
Vacant—2
955 Waicules Eva Mrs
956 Barker Chas
957 Borreggine Dominick—1
Koss Saml—2
958 DeLores Jacob
959 McCall Wm C—1
Mullett Arthur A
Isaacs Clayton—2
959½ Sheppbard Iva Mrs—1
960 Burke Jas W—1
Drake Lucy Mrs—2
Seals Anna M Mrs
962 Tarbell Roy G—1
Love Jesse—2
964 Berman's Restaurant
965 Vacant—2
966 Thousand Wm—1
Knapp Elsie A Mrs—2
967 Mancini Jos gro
970 Roberts Cora J—2
Myers John R—2
Laduc Herbert J—2
972 Rosenberg's Pharmacy
Jackson st crosses

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1939

835 Great Atlantic & Pacific Tea Co gros
Heldt John
Madrid Louis F
E Adams st crosses
900 Bernet Frank second hand furn
901 Meltzer's Auto Supply Co
902 Vacant
904 Evorra Michl
905 Waters Danl B—2
Nichols Dorothy
906 Fineberg Annie Mrs dry gds h—2 ◎
Abdo Nicholas—3
907 Tecler Nathan furn
908 Spraker Wm F—1
Brand Augusta E—2 ◎
909 Tecler Morris furn
909½ Vacant
910 Salomey Thos B
911 Vacant
912 Stubli Caroline M ◎
913 Hook & Ladder No 4
Engine No 16
914 Vacant
Searfoss Chas—2
915 Salt City Movers & Storage Co Inc
916 Jawesh Harry
918 Northrup Ernest C coal and wood h
Cunningham Geo—2
918½ Verdone Frank ◎
919 Salt City Packing & Storage Co
919½ Tarbell Thos—1
Berg Chas E
Adams Louis—2
Nicholas Danl
921 Johnson Dorothy Mrs—1
Schreiner Albert M—2
922 Couse Floyd M
923 Edwards Mitchell—1
LaFave Carl P—2
924 Barlow Angelina Mrs—1
Belair Gordon J
Luce Nellie E Mrs—2
rear Vacant
925 State Rag & Metal Co junk
926 Vacant store
Caldwell Danl—1
Bushnell Helen E Mrs

Target Street	Cross Street	Source
-	✓	Polk's City Directory

S STATE ST 1939

(Building continued)
Meeks Robt B—2
Martin Pauline I Mrs
926½ Bennett Cora Mrs
927 White Frank W—1
Troendle Conrad
Matchuk Frank—2
928 Montondo Wm J—1
Tate Wm M—2
929 Lavine Ben—1
Minsky Harry—2
Katronis Geo G
930 Smith Louis H—1
West Aug F
Trotman Oscar W—2
Impeciato Frank
931 McCloskey Chas C—1
Foley Jos—2
Lamson Gertrude J Mrs
931½ Barber Ellis
932 LaRonde Thos H—1
Wilbur Lemuel J
McCarthy Frank M—2
Migdal Jos
rear Cushnic Jos
933 Haley Anna M—1 ◎
Lamson Preston F
Pope Leslie H—2
Washivick Walter
934 Vandewerkern Harriet Mrs
936 Monette Lawrence—1
Guilbeau Leo
Strong Leonard J—2
Mullett Bertha M Mrs
937 Handelman Rose hairdrsr
Mancini Andrew—1
Handelman Leah Mrs—2 ◎
rear Hnatow Kostanty—1
Torello Raymond—2
938 Gaynor Mary C gro h ◎
939 Hayman's Used Car Co
940 Vacant store
Vacant—1
Hallenbeck Wm—2
Melvin Virginia J Mrs
941 Berry Howard A—1
Berry Allie Mrs
Watson Herman B—2
rear Emery Arthur
942 Bates Geo F—2 ◎
943 Ermakovitz John—1
Wood John J
Lukowski John—2
944 Buckley Kathleen Mrs—1
Barry LeRoy
947 Lavine Herman—1 ◎
Williams Harry H—2
948 Smith & Howell Film Service Inc film delivery
949 Hubler Harry J—1
Molosky Michl—2
951 Wheeler Jennie M Mrs—1
McCabe Morris J
Vacant—2
953 Sparrow Wm A—1
Clark Edwd
Griffin Stephen—2
Myers Robt C
954 Loucks Iva M Mrs—1
Singleton Mayme Mrs
Brooks Edwd—2
955 Waicules Eva Mrs
956 Barker Chas
957 Barreggine Dominick—1
Koss Saml—2
958 Miller Erven Z
959 Clark Fred E—1
Mullett Arthur A
Thomas Wilfred J—2
959½ Wilson Geo X
960 Burke Jas W—1
Drake Lucy Mrs—2
Seals Anna M Mrs
962 Tarbell Roy G—1
Migdal Wm—2
964 Berman Betty restr ◎
965 Mancini Frank—2
966 Perry Emma—1
Shaw Clarence J—2
967 Mancini Jos gro
968 Abdo Nicholas gro
970 Roberts Cora Mrs—2
Kurtz Jas G
Michel Ella Mrs
Freeman Anna A Mrs
972 Rosenberg's Pharmacy
Jackson st crosses
1000 DeSandes Jos gas sta
1001 Neri Jos meats
Vacant—2
1003 Bill's Motorcycle Shop
Harrig Wm H—2

East Adams Redevelopment Phase Three Area
200 Chavez Terrace
Syracuse, NY 13202

Inquiry Number: 7748282.8S
August 29, 2024

EDR Environmental Lien and AUL Search 1980

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

EDR Environmental Lien and AUL Search 1980

The EDR Environmental Lien and AUL Search 1980 report provides results from a search of available land title records for environmental cleanup liens and other activity and use limitations (AULs), such as engineering controls and institutional controls.

A network of professional, trained researchers, following established procedures, uses client supplied address and/or parcel information to:

- search for parcel number and/or legal description
- search for ownership information filed between 1980 and the most current publicly available date
- research official land title documents recorded at jurisdictional agencies such as recorders' offices, registries of deeds, county clerks' offices, etc.
- search for publicly available environmental encumbering instrument(s) filed between 1980 and present
- provide a copy of any environmental encumbrance(s)
- provide a copy of the current deed when available

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Property Archives, LLC researched and compiled the land title information contained in this EDR Environmental Lien and AUL Search 1980 report on behalf of EDR.

Property Archives

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC and Property Archives, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT. Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2024 by Environmental Data Resources, LLC. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, LLC, or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

EDR Environmental Lien and AUL Search 1980

TARGET PROPERTY INFORMATION

ADDRESS

200 Chavez Terrace
Syracuse, NY, 13202

PROPERTY DESCRIPTION

Parcel ID: **09500000080010000000**

Current Owner: Syr Housing Authority/McKinney Manor

Legal Description: Bl P 151-251 Abdn Sts 412.41x1171.23x366.35x116

FINDINGS SUMMARY

The following is a summary of information contained in the report. Additional details may be found in the Findings Detail section.

Parcel: **09500000080010000000**

Environmental Lien: Found ☐ Not Found ☒

Other Activity and Use Limitations (AULs): Found ☐ Not Found ☒

HISTORICAL CHAIN of TITLE FROM 1980			
RECORDED	**INSTRUMENT**	**GRANTEE**	**GRANTOR**
October 31, 1986	3303/178	The Syracuse Housing Authority	Samuel R. Pierce Jr

RESEARCH SOURCE(S)

The following research sources were reviewed from January 01, 1980, to August 28, 2024. Based on available information evaluated by the title search professional, the jurisdiction does not require a search of judicial records to identify environmental liens.

Source 1: Onondaga County Real Property Tax Service
Onondaga County, NY

Source 2: Onondaga County Clerk
Onondaga County, NY

EDR Environmental Lien and AUL Search 1980

FINDINGS DETAIL

Parcel: **09500000080010000000**

ENVIRONMENTAL LIEN

Environmental Lien: Found ☐ Not Found ☒

OTHER ACTIVITY AND USE LIMITATIONS (AULs)

Other AULs: Found ☐ Not Found ☒

MISCELLANEOUS DOCUMENTS

None

HISTORICAL CHAIN OF TITLE FROM 1980

Parcel ID: **09500000080010000000**

DEED TYPE:	Bargain and Sale Deed
GRANTEE:	The Syracuse Housing Authority
GRANTOR:	Samuel R. Pierce Jr
DATE EXECUTED:	October 27, 1986
DATE RECORDED:	October 31, 1986
BOOK / PAGE:	3303/178

*See Attached Deed Exhibit

*Public records of Onondaga County, New York were searched from January 01, 1980 through August 28, 2024 and no other deeds vesting title in the subject property were located during the period searched.

EDR Environmental Lien and AUL Search 1980

CURRENT DEED EXHIBIT(S)

DEED BOOK 3303 PAGE 178

Bargain and Sale Deed – New York

CITY

15185

THIS INDENTURE, Made the 27th day of October, 1986, between Samuel R. Pierce, Jr., Secretary of Housing and Urban Development, of Washington, D.C., acting by and through the Federal Housing Commissioner, party of the first part, and The Syracuse Housing Authority, 516 Burt Street, Syracuse, New York party(ies) of the second part.

WITNESSETH: That the party of the first part, in consideration of the sum of ONE DOLLAR ($1.00) lawful money of the United States, and other good and valuable considerations paid by the party(ies) of the second part, does hereby grant and release unto the party(ies) of the second part, and to the heirs, distributees and assigns of said party(ies) of the second part, forever

PARCEL I

ALL THAT TRACT OR PARCEL OF LAND, situate in the city of Syracuse, County of Onondaga and State of New York, being part of Blocks No. 150 and No. 250 and being part of Jackson Street and Star Avenue (both now abandoned) and being more particularly described as follows:

BEGINNING at a point in the northerly line of East Taylor Street where same is intersected by the easterly line of Montgomery Street; thence North 3° 36' 10" West measured along said easterly line of Montgomery Street a distance of 421.42 feet to a point in the southerly line of New Street; thence South 89° 47' 50" East measured along said southerly line a distance of 288.92 feet to a point in the westerly line of South State Street; thence South 3° 42' 10" East measured along said westerly line a distance of 402.48 feet to a point in the northerly line of East Taylor Street; thence South 86° 26' 30" West measured along said northerly line a distance of 288.98 feet to the place of beginning.

Containing 118,895.00 Square feet of land, more or less.

PARCEL II

ALL THAT TRACT OR PARCEL OF LAND, situate in the City of Syracuse, County of Onondaga and State of New York, being part of Block No. 151 and No. 251 and being part of Jackson Street and Star Avenue (both now abandoned) and being more particularly described as follows:

BEGINNING at the intersection of the easterly line of South State Street and southerly line of East Adams Street; thence North 86° 55' 00" East measured along the southerly line of East Adams Street a distance of 366.35 feet to a point in the southerly line of East Adams Street; thence South 89° 47' 50" East measured along said southerly line of East Adams Street a distance of 46.00 feet to a point in the westerly line of South Townsend Street; thence South 0° 04' 30" West measured along said line of South Townsend Street a distance of 699.99 feet to a point of deflection in same; thence South 3° 37' 00" East continuing along said westerly line of South Townsend Street a distance of 465.15 feet to a point in the northerly line of East Taylor Street; thence South 86° 26' 30" West measured along said northerly line of East Taylor Street a distance of 412.41 feet to a

BEING the same property acquired by the party of the first part pursuant to the provisions of the National Housing Act, as amended *(12 USC 1701 et seq.)* and the Department of Housing and Urban Development Act *(79 Stat. 667)*. (SEE ATTACHED)

TOGETHER WITH the appurtenances and all the estate and rights of the party of the first part in and to said premises.

TO HAVE AND TO HOLD the premises herein granted unto the party(ies) of the second part, and to the heirs, distributees and assigns of said party(ies) of the second part, forever.

SUBJECT TO ALL covenants, restrictions, reservations, easements, conditions and rights appearing of record; and SUBJECT to any state of facts an accurate survey would show.

AND THE party of the first part covenants that he has not done or suffered anything whereby the said premises have been incumbered in any way whatsoever.

The Property being conveyed is hereby made subject to those restrictions contained on the Rider attached hereto and incorporated herein by reference.

05245 RECEIVED $ REAL ESTATE OCT 31 1986 ONONDAGA COUNTY

E TT 3:17 PM 10/31/86 9017 .00/

R DDB 3:17 PM 10/31/86 9016 27.00/

3021/176

Previous Editions are Obsolete

FHA-1859 (6-77)

DEED BOOK 3303 PAGE 179

THE PARTY of the first part covenants that if any improvements, repairs or alterations to the premises have been commenced and have not been completed at least four months before the recording of this deed, the Grantor will receive the consideration for this conveyance and will hold the right to receive such consideration as a trust fund to be applied first for the purpose of paying the cost of improvement, and that said Grantor will apply the same first to the payment of the cost of improvement before using any part of the total of the same for any other purpose.

IN WITNESS WHEREOF the undersigned has set his hand and seal as ~~Field~~ Regional Office ~~Office~~, New York, for and on behalf of the said Secretary of Housing and Urban Development, under authority and by virtue of the Code of Federal Regulations, Title 24, Chapter II, Part 200, Subpart D, and 35 F.R. 16106 (10/14/70), as amended.

Regional Administrator , HUD ~~Regional~~ ~~Office~~,

In presence of:

Secretary of Housing and Urban Development

By: Assistant Secretary for Housing–
Federal Housing Commissioner

By _____ (SEAL)

Field Office
HUD Field Office , New York

STATE OF NEW YORK : ss
COUNTY OF New York

On this 27th day of October , 1986, before me personally came Edmund A. Dairs having his/her official station in New York, New York, and the person described in and who executed foregoing instrument bearing date 1986, by virtue of the above cited authority and acknowledged the same to be his/her free act and deed as ~~Regional~~ Office, Regional Administrator HUD ~~Regional~~ Office, New York , New York, for and on behalf of Secretary of Housing and Urban Development.

Debra A. Hahn
Notary Public

DEBRA A. HAHN
Notary Public, State of New York
No. 31-4823255
Qualified in New York County
Commission Expires March 30, 19 88

3303 PAGE 178

PARCEL II (CONTINUED)

point in the easterly line of South State Street; thence North 3° 42' 10" West measured along the easterly line of South State Street a distance of 462.62 feet to a point of deflection in same;

thence North 0° 06' 00" East continuing along the easterly line of South State Street a distance of 708.61 feet to the place of beginning.

Containing 482,060.24 square feet of land, more or less.

RIDER TO THE BARGAIN AND SALE DEED
BETWEEN THE SECRETARY OF HOUSING AND URBAN DEVELOPMENT
and SYRACUSE HOUSING AUTHORITY
FOR THE SALE OF Mulberry Square Apartments, Syracuse, N.Y.
Project No. 012-55066

1. Nondiscrimination Against Section 8 Certificate Holders

In order to comply with Section 204 of the Housing and Community Development Amendments of 1978, 12 USC §1701z-12, as amended, the Grantee, for itself, its successors and assigns, agrees not to refuse unreasonably to lease a dwelling unit offered for rent, offer or sell cooperative stock, or otherwise discriminate in the terms of tenancy or cooperative purchase and sale because any tenant or purchaser is the holder of a Certificate of Family Participation under Section 8 of the United States Housing Act of 1937 (42 USC 1437F), or any successor legislation (hereinafter referred to as Section 8). This provision is limited to those units which rent for an amount not greater than the Section 8 fair market rent for a comparable unit in the area as determined by the Grantor.

This covenant shall bind the Grantee, its successors, assigns and purchasers for value, for a period of twenty (20) years from the date of this Deed. In the event of a breach or a threatened breach of any of these covenants, the Grantor, its successors in office and/or one or more third-party beneficiaries, shall be entitled to institute legal action to enforce performance and observance of such covenant and to enjoin any acts which are violative of such covenant. For the purposes of this covenant, a third-party beneficiary shall be any person who holds a Certificate of Family Participation under Section 8.

2. Construction and Use of New Housing Units

(1) The Grantee agrees to construct at least seventy-five (75) dwelling units of conventional public housing on the Property in accordance with the Grantor's applicable standards. The units shall be constructed within three (3) years from the date of this Deed or such later time as is permitted in writing by the Grantor.

(2) In order to comply with 12 USC §1701z-11, the Grantee covenants that the units constructed pursuant to paragraph 1 hereof will be maintained as public housing for a period of forty (40) years from the date of initial rent-up of such units or such earlier time as the Grantor may specify in writing (the "Restricted Period").

(3) During the Restricted Period, the Grantee may not market the seventy-five dwelling units constructed in accordance with paragraph (1) hereof for any purpose other than public housing without the Grantor's prior written approval.

(4) These covenants shall run with the land hereby conveyed.

(5) To the fullest extent permitted by law and equity, these covenants shall be binding and in favor of and be enforceable by the Grantor and by his successors in office. The Grantor and his successors in office shall be entitled to (a) institute legal action to enforce performance and observance of these covenants, (b) enjoin any acts which are violative of these covenants, (c) with respect to the Grantee's failure to comply with (1) and (2) above, enter and terminate the estate hereby conveyed, and (d) exercise any other legal or equitable right or remedy with respect to these covenants. These rights and remedies may be exercised separately or in combination.

(6) Following expiration of the Restricted Period, upon request of the Grantee, its successors, assigns or purchasers for value, the Grantor or its successors in office shall execute a recordable documents acknowledging that this covenant has been terminated and is of no further force or effect.

3. Relocation

(1) If temporary relocation is necessary because of rehabilitation, demolition, change in use or sale of the Property or any portion thereof, Grantee shall provide assistance to tenants in locating a decent, safe and sanitary dwelling/housing unit which, to the extent feasible, shall be in a location not generally less desirable than the Property, and reimburse tenants for:

(a) Expenses of moving and any net increase in monthly housing cost (rent and reasonable utility costs) during the temporary displacement period.

(b) Expenses of returning to a repaired or newly-constructed unit on the property.

(2) If permanent relocation is necessary because of rehabilitation, demolition, change in use or sale of the Property or any portion thereof, Grantee shall offer assistance of the following categories to tenants, as may be appropriate.

(a) Advisory services, necessary to locate decent, safe and sanitary and affordable replacement housing which, to the extent feasible, shall be in a location not generally less desirable than the Property.

(b) Reimbursement for reasonable moving expenses, which need not exceed an amount determined by Grantor to be reasonable for the household size and circumstances of the move.

(3) These covenants shall run with the land hereby conveyed.

(4) To the fullest extent permitted by law and equity, these covenants shall be binding for the benefit and in favor of and be enforceable by the Grantor and by his successors in office. The Grantor and his successors in office shall be entitled to (a) institute legal action to enforce performance and observance of these covenants, (b) enjoin acts which are violative of these covenants, (c) exercise any other legal or equitable right or remedy with respect to these covenants. These rights and remedies may be exercised separately or in combination.

(5) Following compliance with the covenants set forth in (1) through (2), above, upon request of the Grantee, its successors, assigns purchasers for value, the Grantor or his successors in office shall execute a recordable document acknowledging that these covenants have been terminated and are of no further force or effect.

4. Equity Participation

(1) In the event the Grantee sells, assigns, transfers or conveys the Property or any portion thereof (collectively a "Sale"), the gross proceeds from the Sale shall be distributed in the following priority:

(i) to the Grantor, seventy-five percent (75%) of the balance of the Gross Sales Price less $1.00 (representing the "Initial Sale" price), and

(ii) to the Grantee, the remaining balance.

The method for distribution of the Sale proceeds shall continue and apply to each Sale of the Property or any portion thereof for a period of ten (10) years from the date of this Deed or up to and including the date of any sale determined by the Grantor to be an arm's length transaction, whichever is earlier.

(2) A "Gross Sales Price" shall mean consideration of any kind directly or indirectly received by the Grantee. "Grantor" shall mean the Grantor and its successors in office. "Grantee" shall mean the Grantee and its successors, assigns and purchasers for value.

(3) The Grantee shall keep or cause to be kept, accurate records of account of any Sale. The Grantor during normal working hours, shall have the right to enter and have free access to inspect all books and records of the Grantee. Upon the written request of the Grantor, the Grantee shall retain an independent certified public accountant who shall prepare an accounting of any Sale.

(4) Grantee agrees that the above provisions regarding the Sale of the Property shall be covenants running with the land and be incorporated in all subsequent conveyances of title until such restrictions have expired by the terms hereof. It is expressly agreed that, upon failure to strictly keep and observe these provisions, the Grantor shall be entitled to:

(i) institute legal action to enforce performance and observance of these covenants,

(ii) enjoin acts which are violative of these covenants,

(iii) enter and terminate the estate hereby conveyed,and

(iv) exercise any other legal or equal right or remedy with respect to these covenants.

(5) These rights and remedies may be exercised separately or in combination.

(6) Following compliance with the covenants set forth in subsection (1) for a period of ten (10) years from the date of the Deed, upon written request of the Grantee, the Grantor shall execute a recordable document acknowledging that these covenants have been terminated and are of no further force or effect.

ONONDAGA COUNTY CLERKS OFFICE
Deed, Recorded on the
31 day of October 1986 at
3:10 P M in Book 3303 Page 178
and examined.

Elaine Lytel
COUNTY CLERK

27 m

East Adams Redevelopment Phase Three Area
200 Chavez Terrace
Syracuse, NY 13202

Inquiry Number: 7748282.7
August 28, 2024

EDR Building Permit Report

Target Property and Adjoining Properties

Environmental Data Resources Inc

6 Armstrong Road
Shelton, CT 06484
800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION

About This Report

Executive Summary

Findings

Glossary

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. **NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT.** Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2023 by Environmental Data Resources, LLC. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, LLC, or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

EDR BUILDING PERMIT REPORT

About This Report

The EDR Building Permit Report provides a practical and efficient method to search building department records for indications of environmental conditions. Generated via a search of municipal building permit records gathered from more than 1,600 cities nationwide, this report will assist you in meeting the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E1527 - 21), or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

Building permit data can be used to identify current and/or former operations and structures/features of environmental concern. The data can provide information on a target property and adjoining properties such as the presence of underground storage tanks, pump islands, sumps, drywells, etc., as well as information regarding water, sewer, natural gas, electrical connection dates, and current/former septic tanks.

Methodology

EDR has developed the EDR Building Permit Report through our partnership with BuildFax, the nation's largest repository of building department records. BuildFax collects, updates, and manages building department records from local municipal governments. The database now includes 30 million permits, on more than 10 million properties across 1,600 cities in the United States.

The EDR Building Permit Report comprises local municipal building permit records, gathered directly from local jurisdictions, including both target property and adjoining properties. Years of coverage vary by municipality. Data reported includes (where available): date of permit, permit type, permit number, status, valuation, contractor company, contractor name, and description.

Incoming permit data is checked at seven stages in a regimented quality control process, from initial data source interview, to data preparation, through final auditing. To ensure the building department is accurate, each of the seven quality control stages contains, on average, 15 additional quality checks, resulting in a process of approximately 105 quality control "touch points."

For more information about the EDR Building Permit Report, please contact your EDR Account Executive at (800) 352-0050.

EDR® Environmental Data Resources Inc

BUILD FAX PROPERTY HISTORY

EXECUTIVE SUMMARY: SEARCH DOCUMENTATION

A search of building department records was conducted by Environmental Data Resources, Inc (EDR) on behalf of Langan Engineering, Inc. on Aug 28, 2024.

TARGET PROPERTY

200 Chavez Terrace
Syracuse, NY 13202

SEARCH METHODS

EDR searches available lists for both the Target Property and Surrounding Properties.

RESEARCH SUMMARY

Building permits identified: **YES**

The following research sources were consulted in the preparation of this report. An "X" indicates where information was identified in the source and provided in this report.

Syracuse

Year	*Source*	*TP*	*Adjoining*
2021	City of Syracuse, Division of Code Enforcement		X
2020	City of Syracuse, Division of Code Enforcement		
2019	City of Syracuse, Division of Code Enforcement		
2018	City of Syracuse, Division of Code Enforcement		
2017	City of Syracuse, Division of Code Enforcement		
2016	City of Syracuse, Division of Code Enforcement		
2015	City of Syracuse, Division of Code Enforcement		X
2014	City of Syracuse, Division of Code Enforcement		
2013	City of Syracuse, Division of Code Enforcement		
2012	City of Syracuse, Division of Code Enforcement		
2011	City of Syracuse, Division of Code Enforcement		
2010	City of Syracuse, Division of Code Enforcement		X
2009	City of Syracuse, Division of Code Enforcement		X
2008	City of Syracuse, Division of Code Enforcement		
2007	City of Syracuse, Division of Code Enforcement		X
2006	City of Syracuse, Division of Code Enforcement		X
2005	City of Syracuse, Division of Code Enforcement		X
2004	City of Syracuse, Division of Code Enforcement		
2003	City of Syracuse, Division of Code Enforcement		
2002	City of Syracuse, Division of Code Enforcement		X
2001	City of Syracuse, Division of Code Enforcement		
2000	City of Syracuse, Division of Code Enforcement		
1999	City of Syracuse, Division of Code Enforcement		
1998	City of Syracuse, Division of Code Enforcement		
1997	City of Syracuse, Division of Code Enforcement		
1996	City of Syracuse, Division of Code Enforcement		
1995	City of Syracuse, Division of Code Enforcement		
1994	City of Syracuse, Division of Code Enforcement		

EXECUTIVE SUMMARY: SEARCH DOCUMENTATION

Year	Source	TP	Adjoining
1993	City of Syracuse, Division of Code Enforcement		
1992	City of Syracuse, Division of Code Enforcement		
1991	City of Syracuse, Division of Code Enforcement		
1990	City of Syracuse, Division of Code Enforcement		
1989	City of Syracuse, Division of Code Enforcement		
1988	City of Syracuse, Division of Code Enforcement		
1987	City of Syracuse, Division of Code Enforcement		
1986	City of Syracuse, Division of Code Enforcement		
1985	City of Syracuse, Division of Code Enforcement		
1984	City of Syracuse, Division of Code Enforcement		
1983	City of Syracuse, Division of Code Enforcement		
1982	City of Syracuse, Division of Code Enforcement		
1981	City of Syracuse, Division of Code Enforcement		
1980	City of Syracuse, Division of Code Enforcement		
1979	City of Syracuse, Division of Code Enforcement		
1978	City of Syracuse, Division of Code Enforcement		
1977	City of Syracuse, Division of Code Enforcement		
1976	City of Syracuse, Division of Code Enforcement		
1975	City of Syracuse, Division of Code Enforcement		
1974	City of Syracuse, Division of Code Enforcement		
1973	City of Syracuse, Division of Code Enforcement		
1972	City of Syracuse, Division of Code Enforcement		
1971	City of Syracuse, Division of Code Enforcement		
1970	City of Syracuse, Division of Code Enforcement		
1969	City of Syracuse, Division of Code Enforcement		
1968	City of Syracuse, Division of Code Enforcement		
1967	City of Syracuse, Division of Code Enforcement		
1966	City of Syracuse, Division of Code Enforcement		
1965	City of Syracuse, Division of Code Enforcement		
1964	City of Syracuse, Division of Code Enforcement		
1963	City of Syracuse, Division of Code Enforcement		
1962	City of Syracuse, Division of Code Enforcement		
1961	City of Syracuse, Division of Code Enforcement		
1960	City of Syracuse, Division of Code Enforcement		

Name: JurisdictionName
Years: Years
Source: Source
Phone: Phone

BUILDING DEPARTMENT RECORDS SEARCHED

Name: Syracuse
Years: 1960-2021
Source: City of Syracuse, Division of Code Enforcement, SYRACUSE, NY
Phone: (315) 448-8600

Name: Ithaca town
Years: 1955-2019
Source: Town of Ithaca, Building and Code Enforcement Department, ITHACA, NY
Phone: (607) 273-1783

Name: De Witt town
Years: 1974-2015
Source: , SYRACUSE, NY
Phone: (315) 446-3910

TARGET PROPERTY FINDINGS

TARGET PROPERTY DETAIL

200 Chavez Terrace
Syracuse, NY 13202

No Permits Found

ADJOINING PROPERTY FINDINGS

ADJOINING PROPERTY DETAIL

The following Adjoining Property addresses were researched for this report. Detailed findings are provided for each address.

E TAYLOR ST

301 E TAYLOR ST

Date:	**9/10/2002**
Permit Type:	**RESIDENTIAL**
Description:	**MC KINNEY MANOR- 119 ANGELOU TERR.**
Permit Description:	**ELECTRICAL**
Work Class:	
Proposed Use:	
Permit Number:	58625
Status:	
Valuation:	$1,000.00
Contractor Company:	
Contractor Name:	

NEW ST

218 NEW ST

Date:	**12/30/2021**
Permit Type:	
Description:	**SHA Storage Building Restoration**
Permit Description:	**Com. Reno/Rem/Chg Occ**
Work Class:	
Proposed Use:	
Permit Number:	45551
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

Date: **11/13/2015**
Permit Type:
Description: **Sprinkler**

Permit Description: **Sprinkler**
Work Class:
Proposed Use:
Permit Number: 21856
Status: Certificate Issued
Valuation: $0.00
Contractor Company:
Contractor Name:

Date: **5/24/2010**
Permit Type: **COMMERCIAL**
Description: **GROUNDS AND GARAGE**

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 97165
Status:
Valuation: $1,100.00
Contractor Company:
Contractor Name:

Date: **8/4/2009**
Permit Type: **COMMERCIAL**
Description:

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 93492
Status:
Valuation: $1,000.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date: **7/21/2009**
Permit Type: **COMMERCIAL**
Description:

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 92878
Status:
Valuation: $500.00
Contractor Company:
Contractor Name:

Date: **10/16/2007**
Permit Type: **COMMERCIAL**
Description: **VEHICLE MAINTENANCE**

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 84824
Status:
Valuation: $205.00
Contractor Company:
Contractor Name:

Date: **5/22/2006**
Permit Type: **COMMERCIAL**
Description: **GROUNDS & GARAGE FACILITY**

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 75515
Status:
Valuation: $620.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date: **4/12/2006**
Permit Type: **COMMERCIAL**
Description: **GROUNDS & GARAGE FACILITY**

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 75492
Status:
Valuation: $700.00
Contractor Company:
Contractor Name:

Date: **12/5/2005**
Permit Type: **COMMERCIAL**
Description:

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 74050
Status:
Valuation: $1,100.00
Contractor Company:
Contractor Name:

Date: **4/15/2005**
Permit Type: **COMMERCIAL**
Description: **GROUNDS AND GARAGE**

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 70771
Status:
Valuation: $2,500.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date: **2/23/2005**
Permit Type: **COMMERCIAL**
Description:

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 70570
Status:
Valuation: $2,100.00
Contractor Company:
Contractor Name:

S STATE ST

900 S STATE ST

Date: **9/16/2002**
Permit Type: **COMMERCIAL**
Description: **FIRE STATION #1**

Permit Description: **HEATING**
Work Class:
Proposed Use:
Permit Number: 58831
Status:
Valuation: $30,435.00
Contractor Company:
Contractor Name:

GLOSSARY

General Building Department concepts

- **ICC:** The International Code Council. The governing body for the building/development codes used by all jurisdictions who've adopted the ICC guidelines. MOST of the US has done this. Canada, Mexico, and other countries use ICC codes books and guides as well. There are a few states who have added guidelines to the ICC codes to better fit their needs. For example, California has added seismic retrofit requirements for most commercial structures.
- **Building Department (Permitting Authority, Building Codes, Inspections Department, Building and Inspections):** This is the department in a jurisdiction where an owner or contractor goes to obtain permits and inspections for building, tearing down, remodeling, adding to, re-roofing, moving or otherwise making changes to any structure, Residential or Commercial.
- **Jurisdiction:** This is the geographic area representing the properties over which a Permitting Authority has responsibility.
- **GC:** General Contractor. Usually the primary contractor hired for any Residential or Commercial construction work.
- **Sub:** Subordinate contracting companies or subcontractors. Usually a "trades" contractor working for the GC. These contractors generally have an area of expertise in which they are licensed like Plumbing, Electrical, Heating and Air systems, Gas Systems, Pools etc. (called "trades").
- **Journeymen:** Sub contractors who have their own personal licenses in one or more trades and work for different contracting companies, wherever they are needed or there is work.
- **HVAC (Mechanical, Heating & Air companies):** HVAC = Heating, Ventilation, and Air Conditioning.
- **ELEC (Electrical, TempPole, TPole, TPower, Temporary Power, Panel, AMP Change, Power Release):** Electrical permits can be pulled for many reasons. The most common reason is to increase the AMPs of power in an electrical power panel. This requires a permit in almost every jurisdiction. Other commons reason for Electrical permits is to insert a temporary power pole at a new construction site. Construction requires electricity, and in a new development, power has yet to be run to the lot. The temporary power pole is usually the very first permit pulled for new development. The power is released to the home owner when construction is complete and this sometimes takes the form of a Power Release permit or inspection.
- **"Pull" a permit:** To obtain and pay for a building permit.
- **CBO:** Chief Building Official
- **Planning Department:** The department in the development process where the building /structural plans are reviewed for their completeness and compliance with building codes
- **Zoning Department:** The department in the development process where the site plans are reviewed for their compliance with the regulations associated with the zoning district in which they are situated.
- **Zoning District:** A pre-determined geographic boundary within a jurisdiction where certain types of structures are permitted / prohibited. Examples are Residential structure, Commercial/Retail structures, Industrial/Manufacturing structures etc. Each zoning district has regulations associated with it like the sizes of the lots, the density of the structures on the lots, the number of parking spaces required for certain types of structures on the lots etc.
- **PIN (TMS, GIS ID, Parcel#):** Property Identification Number and Tax Map System number.
- **State Card (Business license):** A license card issued to a contractor to conduct business.
- **Building Inspector (Inspector):** The inspector is a building department employee that inspects building construction for compliance to codes.
- **C.O.:** Certificate of Occupancy. This is the end of the construction process and designates that the owners now have permission to occupy a structure after its building is complete. Sometimes also referred to as a Certificate of Compliance.

GLOSSARY

Permit Content Definitions

- Permit Number: The alphanumerical designation assigned to a permit for tracking within the building department system. Sometimes the permit number gives clues to its role, e.g. a "PL" prefix may designate a plumbing permit.
- Description: A field on the permit form that allows the building department to give a brief description of the work being done. More often than not, this is the most important field for EP's to find clues to the prior use (s) of the property.
- Permit Type: Generally a brief designation of the type of job being done. For example BLDG-RES, BLDG-COM, ELEC, MECH etc.

Sample Building Permit Data

Date: Nov 09, 2000
Permit Type: Bldg -
New Permit Number: 101000000405
Status: Valuation: $1,000,000.00
Contractor Company: OWNER-BUILDER
Contractor Name:

Description: New one store retail (SAV-ON) with drive-thru pharmacy. Certificate of Occupancy.

East Adams Redevelopment Phase Three Area
200 Chavez Terrace
Syracuse, NY 13202

Inquiry Number: 7748282.6
August 28, 2024

The EDR Property Tax Map Report

EDR® Environmental Data Resources Inc

6 Armstrong Road
Shelton, CT 06484
800.352.0050
www.edrnet.com

EDR Property Tax Map Report

Environmental Data Resources, Inc.'s EDR Property Tax Map Report is designed to assist environmental professionals in evaluating potential environmental conditions on a target property by understanding property boundaries and other characteristics. The report includes a search of available property tax maps, which include information on boundaries for the target property and neighboring properties, addresses, parcel identification numbers, as well as other data typically used in property location and identification.

NO COVERAGE

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction orforecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Appendix F Environmental Database Report

Appendix F Environmental Database Report

East Adams Redevelopment Phase Three Area
200 Chavez Terrace
Syracuse, NY 13202

Inquiry Number: 7748282.2s
August 28, 2024

The EDR Radius Map™ Report with GeoCheck®

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	9
Orphan Summary	919
Government Records Searched/Data Currency Tracking	GR-1

GEOCHECK ADDENDUM

Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-5
Physical Setting Source Map	A-9
Physical Setting Source Map Findings	A-11
Physical Setting Source Records Searched	PSGR-1

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. **NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA) INFORMATION PROVIDED IN THIS REPORT.** Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2024 by Environmental Data Resources, LLC. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, LLC, or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E1527 - 21), the ASTM Standard Practice for Environmental Site Assessments for Forestland or Rural Property (E2247 - 16), the ASTM Standard Practice for Limited Environmental Due Diligence: Transaction Screen Process (E1528 - 22) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

200 CHAVEZ TERRACE
SYRACUSE, NY 13202

COORDINATES

Latitude (North):	43.0409570 - 43° 2' 27.44''
Longitude (West):	76.1468740 - 76° 8' 48.74''
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	406579.2
UTM Y (Meters):	4765786.0
Elevation:	398 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	14115660 SYRACUSE WEST, NY
Version Date:	2019
East Map:	14115658 SYRACUSE EAST, NY
Version Date:	2019

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from:	20190802
Source:	USDA

MAPPED SITES SUMMARY

Target Property Address:
200 CHAVEZ TERRACE
SYRACUSE, NY 13202

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
1	NY1-1 PIONEER HOMES	ADAMS/RENWICK/TAYLOR	NY UST	Higher	1 ft.
A2	EAST ADAMS REDEVELOP	100 ANGELOU TERRACE	NY BROWNFIELDS	Lower	122, 0.023, NNW
A3	SYRACUSE POLICE DEPT	916 S STATE ST	UST FINDER	Lower	151, 0.029, NNW
A4	SYRACUSE POLICE DEPT	916 S STATE ST	NY UST	Lower	151, 0.029, NNW
B5	SYRACUSE HOUSING AUT	218 NEW ST	RCRA-SQG, NY MANIFEST	Lower	210, 0.040, WSW
B6	SYRACUSE HOUSING AUT	218 NEW STREET	PA MANIFEST	Lower	210, 0.040, WSW
A7	FIRE STATION #1	900 SOUTH STATE ST	UST FINDER	Lower	242, 0.046, NNW
A8	NIAGARA MOHAWK A NAT	900 SOUTH STATE STRE	NY MANIFEST	Lower	242, 0.046, NNW
A9	FIRE STATION #1	900 SOUTH STATE ST	NY UST	Lower	242, 0.046, NNW
A10	NIAGARA MOHAWK, A NA	SOUTH STATE STREET	RCRA NonGen / NLR, E MANIFEST	Lower	242, 0.046, NNW
A11	FIRE STATION #1	900 SOUTH STATE ST	NY AST	Lower	242, 0.046, NNW
B12	S STATE STREET	S STATE ST/NEW STREE	NY LTANKS	Higher	244, 0.046, SSW
C13	SYRACUSE HOUSING AUT	116-118 RADISSON COU	RCRA-SQG, NY MANIFEST	Higher	258, 0.049, ESE
C14	PARKING LOT- 111 RAD	111 RADISON CT	NY Spills	Higher	296, 0.056, ESE
D15	MANHOLE 7-1	907 SOUTH TOWNSEND S	NY Spills	Lower	303, 0.057, NNE
D16	DABLON COURT	DABLON COURT (PIONEE	NY Spills	Higher	328, 0.062, NE
E17	CITY OWNED APARTMENT	301-311 EAST TAYLOR	NY Spills	Higher	345, 0.065, South
F18	ONONDAGA CO. HEALTH	STATE STREET SITE	NY LTANKS	Lower	382, 0.072, NNW
F19	NY1-1 PIONEER HOMES	ADAMS/RENWICK/TAYLOR	NY AST	Lower	410, 0.078, NNW
F20	EAST COLVIN AND	STATE STREET	NY Spills	Lower	419, 0.079, NNW
F21	ADAMS & STATE ST. GA	ADAMS & STATE STREET	UST FINDER RELEASE	Lower	427, 0.081, NNW
F22	PARKING GARAGE	STATE ST & ADAMS ST	NY Spills	Lower	427, 0.081, NNW
F23	ADAMS & STATE ST. GA	ADAMS & STATE STREET	NY LTANKS	Lower	427, 0.081, NNW
G24	STEAM PLANT	MCBRIDE ST	NY LTANKS	Higher	501, 0.095, SE
E25	THE SALVATION ARMY	1105 S. STATE ST	NY UST	Higher	506, 0.096, South
E26	FORMER SALVATION ARM	1105 SOUTH STATE ST	UST FINDER RELEASE	Higher	506, 0.096, South
E27	THE SALVATION ARMY	1105 S. STATE ST	UST FINDER	Higher	506, 0.096, South
E28	SPILL NUMBER 8601904	1105 SOUTH STATE ST	NY Spills	Higher	506, 0.096, South
E29	SALVATION ARMY	1105 SOUTH STATE ST	NY LTANKS, NY Spills	Higher	506, 0.096, South
E30	SALVATION ARMY	1105 SOUTH STATE ST	UST FINDER RELEASE	Higher	506, 0.096, South
E31	EAST ADAMS REDEVELOP	1105-1117 SOUTH STAT	NY BROWNFIELDS	Higher	506, 0.096, South
F32	CENTRAL TECH	285 E. ADAMS ST	UST FINDER	Lower	511, 0.097, NNW
F33	CENTRAL TECH	285 E. ADAMS ST	NY UST	Lower	511, 0.097, NNW
E34	ROTH BROS METAL CO.	1107 S. STATE STREET	SEMS-ARCHIVE, LEAD SMELTERS	Higher	516, 0.098, South
35	PIONEER HOMES	MONROE ST	NY Spills	Higher	536, 0.102, ENE
H36	INSTITUTE OF TECHNOL	258 EAST ADAMS ST	NY Spills	Lower	541, 0.102, NW
H37	SYRACUSE CITY SCHOOL	258 E ADAMS ST	PA MANIFEST	Lower	541, 0.102, NW
H38	INSTITUTE OF TECHNOL	258 E ADAMS ST	RCRA NonGen / NLR, NY MANIFEST	Lower	541, 0.102, NW
F39	ONON.CO. PARKING GAR	ADDAMS ST	NY Spills	Lower	554, 0.105, North

MAPPED SITES SUMMARY

Target Property Address:
200 CHAVEZ TERRACE
SYRACUSE, NY 13202

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
I40	DI PINO ANTHONY	1117 SOUTH STATE ST	EDR Hist Auto	Higher	564, 0.107, South
I41	FORMER SALVATION ARM	1117 SOUTH STATE ST	NY UST	Higher	564, 0.107, South
G42	INTERSECTION OF	EAST TAYLOR/SOUTH MC	NY Spills	Higher	575, 0.109, SE
G43	TAYLOR & MCBRIDE ST.	TAYLOR AND MCBRIDE S	NY Spills	Higher	592, 0.112, SE
G44	E. TAYLOR AND MCBRID	EAST TAYLOR AND MCBR	NY Spills	Higher	592, 0.112, SE
G45	STEAM HEAT SYR. UNIV	TALOR & MCBRIDE ST	NY Spills	Higher	613, 0.116, ESE
G46	SU CHILLED WATER PLA	500 E. TAYLOR STREET	NY AST, NY CBS AST	Higher	613, 0.116, SE
G47	SYRACUSE UNIVERSITY	500 E. TAYLOR STREET	NY CBS AST	Higher	613, 0.116, SE
G48	SYRACUSE UNIVERSITY	500 EAST TAYLOR STRE	NY CBS, NY AST, NY Spills, NY MANIFEST	Higher	613, 0.116, SE
G49	STEAM STATION	500 EAST TAYLOR ST	NY Spills	Higher	613, 0.116, SE
G50	SYRACUSE UNIVERSITY	500 EAST TAYLOR ST	NY LTANKS, NY Spills, NY AIRS	Higher	613, 0.116, SE
G51	SYRACUSE UNIVERSITY	500 EAST TAYLOR ST	UST FINDER	Higher	613, 0.116, SE
G52	SYRACUSE UNIVERSITY-	500 EAST TAYLOR ST	RCRA NonGen / NLR, E MANIFEST, NJ MANIFEST	Higher	613, 0.116, SE
G53	SYRACUSE UNIV STEAM	500 EAST TAYLOR ST	NY Spills	Higher	613, 0.116, SE
G54	SYRACUSE UNIVERSITY	500 EAST TAYLOR ST	NY UST, NY AST	Higher	613, 0.116, SE
55	ONONDAGA CO CONVENTI	S STATE ST	RCRA NonGen / NLR, NY MANIFEST	Lower	658, 0.125, NNW
J56	SYRACUSE HOUSING AUT	409 BURT STREET	RCRA-LQG, FINDS, ECHO, NY MANIFEST	Higher	662, 0.125, SSE
J57	MCKINNEY PROPERTY	1226 SOUTH MCBRIDE S	NY ENG CONTROLS, NY INST CONTROL, NY ERP, NY...	Higher	689, 0.130, SE
G58	MC BRIDE SUB	S MCBRIDE	RCRA NonGen / NLR, NY MANIFEST	Higher	723, 0.137, SE
K59	CENTRAL VILLAGE HOUS	302 BURT ST	NY UST	Lower	752, 0.142, South
K60	CENTRAL VILLAGE HOUS	302 BURT ST	UST FINDER	Lower	752, 0.142, South
K61	EAST ADAMS REDEVELOP	300 BURT STREET	NY BROWNFIELDS	Lower	754, 0.143, South
62	SYRACUSE HOUSING AUT	120-122 TYLER COURT	RCRA-SQG, NY MANIFEST	Higher	793, 0.150, ENE
L63	WAREHOUSE	908 MONTGOMERY ST	NY UST	Lower	823, 0.156, SSW
64	CENTRO PARKING INC.	SUNY HEALTH SRV. CEN	NY LTANKS	Higher	836, 0.158, NNE
65	HARRISON PL & E ADAM	HARRISON PL & E ADAM	NY LTANKS	Lower	844, 0.160, NW
66	SYRACUSE HOUSING AUT	BURT & MCBRIDE ST	PA MANIFEST	Higher	855, 0.162, SE
M67	SCHC COMPANIES, INC.	800 S. SALINA ST	UST FINDER	Higher	890, 0.169, WSW
M68	SCHC CO INC CORP OFF	800 S SALINA ST	RCRA NonGen / NLR, FINDS, ECHO	Higher	890, 0.169, WSW
M69	SCHC COMPANIES INC	800 S SALINA ST	RCRA NonGen / NLR, NY MANIFEST	Higher	890, 0.169, WSW
M70	SCHC COMPANIES, INC.	800 S. SALINA ST	NY UST	Higher	890, 0.169, WSW
N71	BENJAMIN RUSH CENTER	672 S SALINA ST	UST FINDER	Lower	954, 0.181, West
N72	BENJAMIN RUSH CENTER	672 S SALINA ST	NY UST	Lower	954, 0.181, West
N73	JUPP CORP	680 SOUTH SALINA ST	UST FINDER	Lower	957, 0.181, West
N74	680 SOUTH SALINA ST	680 SOUTH SALINA ST	NY LTANKS, NY Spills	Lower	957, 0.181, West
N75	DESIMONES SERVICE ST	680 S. SALINA ST	UST FINDER RELEASE	Lower	957, 0.181, West
N76	CAN AM ALLIANCE CORP	680 SOUTH SALINA ST	NY UST	Lower	957, 0.181, West
L77	FAMILY DOLLAR #5071	945 S SALINA ST	NY MANIFEST	Lower	957, 0.181, SW
L78	FAMILY DOLLAR #5071	945 S SALINA ST	RCRA-VSQG, ECHO	Lower	957, 0.181, SW

MAPPED SITES SUMMARY

Target Property Address:
200 CHAVEZ TERRACE
SYRACUSE, NY 13202

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
79	NIAGARA MOHAWK POWER	235 OAKWOOD AVE. EXT	NY LTANKS, NY Spills, NY MANIFEST	Higher	964, 0.183, SSE
O80	NIAGARA MOHAWK A NAT	400 HARRISON ST	RCRA NonGen / NLR, NY MANIFEST	Lower	974, 0.184, North
P81	SYRACUSE HOUSING AUT	101-102 DYER COURT	RCRA-VSQG	Higher	987, 0.187, East
Q82	CENTRAL GARAGE	700-712 S. TOWNSEND	UST FINDER	Higher	990, 0.188, NNE
Q83	CENTRAL GARAGE	700-712 S. TOWNSEND	NY UST	Higher	990, 0.188, NNE
O84	NIAGARA MOHAWK A NAT	S STATE ST & HARRISO	NY MANIFEST	Lower	993, 0.188, North
O85	NIAGARA MOHAWK A NAT	S STATE ST & HARRISO	RCRA NonGen / NLR	Lower	993, 0.188, North
R86	PROJECT ORANGE	520 E TAYLOR ST	NY CBS, NY AST, NY CBS AST, NY Spills, RCRA NonGen...	Higher	1022, 0.194, ESE
S87	SYRACUSE COMMUNITY H	930 S SALINA ST	RCRA-SQG, FINDS, ECHO, NY MANIFEST	Lower	1043, 0.198, SW
S88	SYRACUSE COMMUNITY H	819 S SALINA ST	RCRA NonGen / NLR, NY MANIFEST	Lower	1046, 0.198, SW
S89	SYRACUSE COMMUNITY H	819 SOUTH SALINA STR	PA MANIFEST	Lower	1046, 0.198, SW
T90	HARRISON CONVENTION	HARRISON & MONTGOMER	UST FINDER RELEASE	Lower	1054, 0.200, NNW
P91	NYSDOT BIN 1031569	I-81/EAST ADAMS STRE	RCRA NonGen / NLR, NY MANIFEST	Higher	1063, 0.201, ESE
92	SYRACUSE HOUSING AUT	516 BURT ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST	Higher	1125, 0.213, SE
R93	SYRACUSE HOUSING AUT	1207 ALMOND STREET	PA MANIFEST	Higher	1159, 0.220, ESE
R94	SYRACUSE HOUSING AUT	1207 ALMOND ST	RCRA-SQG, E MANIFEST, NY MANIFEST	Higher	1159, 0.220, ESE
95	NIAGARA MOHAWK POWER	599 S SALINA MH8-4	RCRA-SQG	Lower	1172, 0.222, WNW
U96	AMERICAN RED CROSS	636 SOUTH WARREN ST	NY Spills, NY MANIFEST	Lower	1176, 0.223, NW
U97	AMERICAN RED CROSS	636 S WARREN ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST	Lower	1176, 0.223, NW
V98	SOUTH SALINA SIDA	1016-1018 MONTGOMERY	NY SHWS	Lower	1181, 0.224, SSW
W99	224 HARRISON ST ASSO	224 HARRISON ST	E MANIFEST	Lower	1187, 0.225, NW
T100	ONONDAGA COUNTY WAR	515 MONTGOMERY STREE	PA MANIFEST	Lower	1262, 0.239, NNW
T101	ONONDAGA COUNTY WAR	515 MONTGOMERY ST	RCRA-SQG, FINDS, ECHO	Lower	1262, 0.239, NNW
T102	ONONDAGA COUNTY OF	515 MONTGOMERY ST	NY MANIFEST	Lower	1262, 0.239, NNW
V103	1045-1047 SOUTH SALI	1045 SOUTH SALINA ST	US BROWNFIELDS, FINDS	Lower	1305, 0.247, SSW
104	SPILL NUMBER 8601815	600 S. STATE ST @ CI	NY LTANKS	Lower	1329, 0.252, North
W105	HARRISON PARKING GAR	WARREN & HARRISON ST	NY LTANKS	Lower	1351, 0.256, NW
W106	HARRISON PARKING GAR	WARREN & HARRISON ST	UST FINDER RELEASE	Lower	1351, 0.256, NW
V107	1049-1071 SOUTH SALI	1049-1071 SOUTH SALI	US BROWNFIELDS, FINDS	Lower	1391, 0.263, SSW
X108	RENALLI TAYLOR ST LL	140 CORTLAND AVE	NY LTANKS, NY CBS, NY CBS AST, NY BROWNFIELDS, NY...	Lower	1473, 0.279, SW
X109	FORMER COYNE TEXTILE	140 CORTLAND AVENUE	NY ENG CONTROLS, NY INST CONTROL, NY BROWNFIELDS	Lower	1473, 0.279, SW
Y110	1073-1079 SOUTH SALI	1073-1079 SOUTH SALI	US BROWNFIELDS, FINDS	Lower	1478, 0.280, SSW
Y111	1081-1085 SOUTH SALI	1081-1085 SOUTH SALI	US BROWNFIELDS, FINDS	Lower	1507, 0.285, SSW
Y112	SOUTH SALINA STREET	1081 SOUTH SALINA ST	NY BROWNFIELDS, NY Spills	Lower	1507, 0.285, SSW
113	S&F AUTOMOTIVE	420 ONEIDA ST	NY LTANKS	Lower	1541, 0.292, WSW
Z114	MONTGOMERY STREET	MONGOMERY ST AND MAD	NY LTANKS	Lower	1547, 0.293, NNW
Y115	1101-1111 SOUTH SALI	1101-1111 SOUTH SALI	US BROWNFIELDS, FINDS	Lower	1547, 0.293, SSW
AA116	CHIMES BUILDING	500-550 SOUTH SALINA	NY BROWNFIELDS	Lower	1555, 0.295, WNW
AA117	500 SOUTH SALINA STR	500 SOUTH SALINA STR	UST FINDER RELEASE	Lower	1555, 0.295, WNW

MAPPED SITES SUMMARY

Target Property Address:
200 CHAVEZ TERRACE
SYRACUSE, NY 13202

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
AB118	DISTRICT HEATING & C	601 S STATE ST	NY LTANKS, NY Spills, NY AIRS, NY MANIFEST	Lower	1619, 0.307, North
AB119	STEAM STATION-S.STAT	601 S. STATE ST	UST FINDER RELEASE	Lower	1619, 0.307, North
Z120	CATHEDRAL IMMACULATE	420 MONTGOMERY AVE	NY LTANKS	Lower	1634, 0.309, NNW
121	BYRNE DAIRY INC.	240 ONEIDA STREET	NY LTANKS, NY UST, NY CBS, NY AST, NY Spills, NY...	Lower	1649, 0.312, West
AA122	COUNTY SEWER ROW	CLINTON AND WEST ONO	UST FINDER RELEASE	Lower	1722, 0.326, WNW
AC123	500 WARREN ST	500 WARREN ST	UST FINDER RELEASE	Lower	1757, 0.333, NNW
AC124	HOTEL SYRACUSE	500 S WARREN ST	RCRA-VSQG, NY LTANKS, US AIRS, NY MANIFEST	Lower	1757, 0.333, NNW
AD125	BYRNE DAIRY	KING ST	NY LTANKS	Lower	1773, 0.336, WSW
AD126	BYRNE DAIRY	235 KING STREET	NY LTANKS	Lower	1773, 0.336, WSW
AE127	MONDO'S AGWAY	1127 SO. SALINA ST	UST FINDER RELEASE	Lower	1805, 0.342, SSW
AE128	MONDO'S	1127 SOUTH SALINA ST	NY LTANKS, NY UST, NY Spills	Lower	1805, 0.342, SSW
129	HUTCHINGS PSYCH CENT	620 MADISON STREET	NY LTANKS, NY Spills	Higher	1839, 0.348, NE
130	JMA CAMPUS PLAN	623 ONEIDA STREET	NY BROWNFIELDS	Lower	1841, 0.349, SW
AE131	MONDO'S SERVICE STAT	1133 SOUTH SALINA	NY LTANKS	Lower	1843, 0.349, SSW
AE132	MONDO'S SERVICE STAT	1133 SOUTH SALINA	UST FINDER RELEASE	Lower	1843, 0.349, SSW
133	SUNY HEALTH SCIENCE	750 EAST ADAMS STREE	NY LTANKS, NY CBS, NY AST, NY CBS AST, NY Spills,...	Higher	1863, 0.353, ENE
AD134	ATLAS SERVICES	TAYLOR ST; KING ST	NY LTANKS	Lower	1915, 0.363, WSW
AF135	HUTCHINGS	500 CEDAR ST	UST FINDER RELEASE	Higher	1938, 0.367, NE
AF136	HUTCHINGS PSYCHIATRI	BLDG 11	NY LTANKS	Higher	1971, 0.373, NE
AG137	H.S.M.PACKAGING CORP	123 LARNED ST	NY LTANKS	Lower	2012, 0.381, West
AG138	H.S.M.PACKAGING CORP	123 LARNED ST	UST FINDER RELEASE	Lower	2012, 0.381, West
139	NYS ARMORY JEFFERSON	JEFFERSON ST. ARMORY	NY LTANKS	Lower	2021, 0.383, North
140	CLARK HALL; CROUSE I	ELIZABETH BLACKWELL	NY LTANKS	Higher	2024, 0.383, ENE
AH141	PRESIDENTIAL PLAZA	90 PRESIDENTIAL PLAZ	UST FINDER RELEASE	Higher	2034, 0.385, NNE
AH142	PRESIDENTIAL PLAZA	90 PRESIDENTIAL PLAZ	NY LTANKS	Higher	2034, 0.385, NNE
143	ATLAS LINEN	320 WEST TAYLOR ST	UST FINDER RELEASE	Lower	2049, 0.388, WSW
AI144	V.A. MEDICAL CENTER	800 IRIVING AVENUE	UST FINDER RELEASE	Higher	2064, 0.391, ESE
AI145	V.A. MEDICAL CENTER	800 IRIVING AVENUE	NY LTANKS	Higher	2064, 0.391, ESE
AH146	PRESIDENTIAL PLAZA	PRESIDENTIAL PLAZA	NY LTANKS	Higher	2074, 0.393, NNE
147	MEDICAL RESEARCH BLD	625 MADISON STREET	NY LTANKS, NY Spills	Higher	2162, 0.409, NE
AJ148	743 IRVING AVE.	743 IRVING AVE	UST FINDER RELEASE	Higher	2188, 0.414, East
AJ149	743 IRVING AVE.	743 IRVING AVE	NY LTANKS	Higher	2188, 0.414, East
AK150	CASTLE REST NURSE HO	401 E CASTLE ST	NY LTANKS	Higher	2209, 0.418, SSE
AK151	CASTLE REST NURSE HO	401 E CASTLE ST	UST FINDER RELEASE	Higher	2209, 0.418, SSE
152	HUTCHINGS PSYCH CENT	540 CEDAR - BUILDING	RCRA-VSQG, NY LTANKS, NY Spills, ICIS, FINDS,...	Higher	2212, 0.419, NE
AL153	CARRIER DOME	FOSTER DRIVE	NY LTANKS	Higher	2231, 0.423, ESE
AM154	CNY CENTRO INC.	200 CORTLAND AVE.	NY LTANKS, NY CBS, NY Spills, NY AIRS	Lower	2244, 0.425, SSW
AM155	CENTRAL BUS CNYRTA M	200 CORTLAND AVE	NY LTANKS, NY Spills, NY COOLING TOWERS	Lower	2244, 0.425, SSW
AL156	SYRACUSE UNIV	900 IRVING AVE	NY LTANKS, NY Spills	Higher	2262, 0.428, ESE

MAPPED SITES SUMMARY

Target Property Address:
200 CHAVEZ TERRACE
SYRACUSE, NY 13202

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
AN157	SPILL NUMBER 9908209	377 WEST ONONDAGA ST	NY LTANKS, NY Spills, NY MANIFEST	Lower	2278, 0.431, West
AN158	ELEVATOR SHAFT	377 WEST ONONDAGA ST	UST FINDER RELEASE	Lower	2278, 0.431, West
AN159	SPILL NUMBER 9908209	377 WEST ONONDAGA ST	UST FINDER RELEASE	Lower	2278, 0.431, West
AO160	FORMER ACCURATE DIE	547 EAST GENESEE STR	NY LTANKS	Higher	2326, 0.441, NNE
AO161	FORMER ACCURATE DIE	547 EAST GENESEE STR	UST FINDER RELEASE	Higher	2326, 0.441, NNE
162	MARKS HOTEL	ALMOND/E GENESSE ST	NY LTANKS	Higher	2347, 0.445, NNE
163	N.Y. TELE. - FAYETTE	FAYETTE ST & STATE S	NY LTANKS, NY Spills	Higher	2568, 0.486, North
AP164	CASTLE REST NURSING	116 EAST CASTLE ST	NY LTANKS, NY Spills	Higher	2578, 0.488, South
AP165	SPILL NUMBER 9900884	116 EAST CASTLE ST	UST FINDER RELEASE	Higher	2578, 0.488, South
166	SPILL NUMBER 9710355	713 EAST GENESEE ST	NY LTANKS, NY Spills	Higher	2587, 0.490, NNE
167	FORMER BROWN MANUFAC	101 CHESTER STREET	NY SHWS, NY ENG CONTROLS, NY INST CONTROL, NY ERP	Lower	3874, 0.734, SW
168	NIMO - SYRACUSE - ER	300 ERIC BLVD WEST	EDR MGP	Higher	4070, 0.771, NNW
169	NM - SYRACUSE ERIE B	300 ERIE BLVD WEST	NY SHWS, NY LTANKS, NY ENG CONTROLS, NY INST...	Higher	4258, 0.806, NW

EXECUTIVE SUMMARY

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal NPL (Superfund) sites

NPL ---------- National Priority List
Proposed NPL ---------- Proposed National Priority List Sites
NPL LIENS ---------- Federal Superfund Liens

Lists of Federal Delisted NPL sites

Delisted NPL ---------- National Priority List Deletions

Lists of Federal sites subject to CERCLA removals and CERCLA orders

FEDERAL FACILITY ---------- Federal Facility Site Information listing
SEMS ---------- Superfund Enterprise Management System

Lists of Federal RCRA facilities undergoing Corrective Action

CORRACTS ---------- Corrective Action Report

Lists of Federal RCRA TSD facilities

RCRA-TSDF ---------- RCRA - Treatment, Storage and Disposal

Federal institutional controls / engineering controls registries

LUCIS ---------- Land Use Control Information System
US ENG CONTROLS ---------- Engineering Controls Sites List
US INST CONTROLS ---------- Institutional Controls Sites List

Federal ERNS list

ERNS ---------- Emergency Response Notification System

Lists of state and tribal landfills and solid waste disposal facilities

NY SWF/LF ---------- Facility Register

Lists of state and tribal leaking storage tanks

INDIAN LUST ---------- Leaking Underground Storage Tanks on Indian Land

NY HIST LTANKS ---- Listing of Leaking Storage Tanks

Lists of state and tribal registered storage tanks

FEMA UST ---- Underground Storage Tank Listing
NY CBS UST ---- Chemical Bulk Storage Database
NY MOSF UST ---- Major Oil Storage Facilities Database
NY MOSF ---- Major Oil Storage Facility Site Listing
NY MOSF AST ---- Major Oil Storage Facilities Database
INDIAN UST ---- Underground Storage Tanks on Indian Land
NY TANKS ---- Storage Tank Faciliy Listing

State and tribal institutional control / engineering control registries

NY RES DECL ---- Restrictive Declarations Listing

Lists of state and tribal voluntary cleanup sites

NY VCP ---- Voluntary Cleanup Agreements
INDIAN VCP ---- Voluntary Cleanup Priority Listing

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

NY SWRCY ---- Registered Recycling Facility List
NY SWTIRE ---- Registered Waste Tire Storage & Facility List
INDIAN ODI ---- Report on the Status of Open Dumps on Indian Lands
DEBRIS REGION 9 ---- Torres Martinez Reservation Illegal Dump Site Locations
ODI ---- Open Dump Inventory
IHS OPEN DUMPS ---- Open Dumps on Indian Land

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL ---- Delisted National Clandestine Laboratory Register
NY DEL SHWS ---- Delisted Registry Sites
US CDL ---- National Clandestine Laboratory Register

Local Lists of Registered Storage Tanks

NY HIST UST ---- Historical Petroleum Bulk Storage Database
NY HIST AST ---- Historical Petroleum Bulk Storage Database

Local Land Records

NY LIENS ---- Spill Liens Information
LIENS 2 ---- CERCLA Lien Information

Records of Emergency Release Reports

HMIRS ---- Hazardous Materials Information Reporting System
NY Hist Spills ---- SPILLS Database
NY SPILLS 90 ---- SPILLS 90 data from FirstSearch
NY SPILLS 80 ---- SPILLS 80 data from FirstSearch

Other Ascertainable Records

FUDS	Formerly Used Defense Sites
DOD	Department of Defense Sites
SCRD DRYCLEANERS	State Coalition for Remediation of Drycleaners Listing
US FIN ASSUR	Financial Assurance Information
EPA WATCH LIST	EPA WATCH LIST
2020 COR ACTION	2020 Corrective Action Program List
TSCA	Toxic Substances Control Act
TRIS	Toxic Chemical Release Inventory System
SSTS	Section 7 Tracking Systems
ROD	Records Of Decision
RMP	Risk Management Plans
RAATS	RCRA Administrative Action Tracking System
PRP	Potentially Responsible Parties
PADS	PCB Activity Database System
FTTS	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
MLTS	Material Licensing Tracking System
COAL ASH DOE	Steam-Electric Plant Operation Data
COAL ASH EPA	Coal Combustion Residues Surface Impoundments List
PCB TRANSFORMER	PCB Transformer Registration Database
RADINFO	Radiation Information Database
HIST FTTS	FIFRA/TSCA Tracking System Administrative Case Listing
DOT OPS	Incident and Accident Data
CONSENT	Superfund (CERCLA) Consent Decrees
INDIAN RESERV	Indian Reservations
FUSRAP	Formerly Utilized Sites Remedial Action Program
UMTRA	Uranium Mill Tailings Sites
US MINES	Mines Master Index File
MINES MRDS	Mineral Resources Data System
ABANDONED MINES	Abandoned Mines
DOCKET HWC	Hazardous Waste Compliance Docket Listing
UXO	Unexploded Ordnance Sites
FUELS PROGRAM	EPA Fuels Program Registered Listing
PFAS NPL	Superfund Sites with PFAS Detections Information
PFAS FEDERAL SITES	Federal Sites PFAS Information
PFAS TRIS	List of PFAS Added to the TRI
PFAS TSCA	PFAS Manufacture and Imports Information
PFAS RCRA MANIFEST	PFAS Transfers Identified In the RCRA Database Listing
PFAS ATSDR	PFAS Contamination Site Location Listing
PFAS WQP	Ambient Environmental Sampling for PFAS
PFAS PROJECT	NORTHEASTERN UNIVERSITY PFAS PROJECT
PFAS NPDES	Clean Water Act Discharge Monitoring Information
PFAS ECHO FIRE TRAIN	Facilities in Industries that May Be Handling PFAS Listing
PFAS PT 139 AIRPORT	All Certified Part 139 Airports PFAS Information Listing
AQUEOUS FOAM NRC	Aqueous Foam Related Incidents Listing
BIOSOLIDS	ICIS-NPDES Biosolids Facility Data
NY PFAS	PFAS Contamination Site Location Listing
NY COAL ASH	Coal Ash Disposal Site Listing
NY E DESIGNATION	E DESIGNATION SITE LISTING
NY Financial Assurance	Financial Assurance Information Listing
NY HSWDS	Hazardous Substance Waste Disposal Site Inventory
NY LEAD	Lead-based Paint Testing Results

EXECUTIVE SUMMARY

NY VAPOR REOPENED Vapor Intrusion Legacy Site List
NY UIC Underground Injection Control Wells
NY NYC OER OER Cleanup Sites Listing
NY ILI New York State Inactive Landfill Initiative
NY NYC LAND USE New York City Land Use Information

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR Hist Cleaner EDR Exclusive Historical Cleaners

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

NY RGA HWS Recovered Government Archive State Hazardous Waste Facilities List
NY RGA LF Recovered Government Archive Solid Waste Facilities List

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.
Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal CERCLA sites with NFRAP

SEMS-ARCHIVE: SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that. based upon available information, the location is not judged to be potential NPL site.

A review of the SEMS-ARCHIVE list, as provided by EDR, and dated 04/22/2024 has revealed that there is 1 SEMS-ARCHIVE site within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
ROTH BROS METAL CO.	***1107 S. STATE STREET***	***S 0 - 1/8 (0.098 mi.)***	***E34***	***66***

Lists of Federal RCRA generators

RCRA-LQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

A review of the RCRA-LQG list, as provided by EDR, and dated 06/03/2024 has revealed that there is 1 RCRA-LQG site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT EPA ID:: NY0000201889	***409 BURT STREET***	***SSE 1/8 - 1/4 (0.125 mi.)***	***J56***	***247***

RCRA-SQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

A review of the RCRA-SQG list, as provided by EDR, and dated 06/03/2024 has revealed that there are 7 RCRA-SQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT EPA ID:: NYR000154476	***116-118 RADISSON COU***	***ESE 0 - 1/8 (0.049 mi.)***	***C13***	***34***
SYRACUSE HOUSING AUT EPA ID:: NYR000154492	***120-122 TYLER COURT***	***ENE 1/8 - 1/4 (0.150 mi.)***	***62***	***314***
SYRACUSE HOUSING AUT EPA ID:: NYR000154468	***1207 ALMOND ST***	***ESE 1/8 - 1/4 (0.220 mi.)***	***R94***	***490***

Lower Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT EPA ID:: NYR000171124	***218 NEW ST***	***WSW 0 - 1/8 (0.040 mi.)***	***B5***	***18***
SYRACUSE COMMUNITY H EPA ID:: NYR000199190	***930 S SALINA ST***	***SW 1/8 - 1/4 (0.198 mi.)***	***S87***	***456***
NIAGARA MOHAWK POWER EPA ID:: NYP000263509	599 S SALINA MH8-4	WNW 1/8 - 1/4 (0.222 mi.)	95	496
ONONDAGA COUNTY WAR EPA ID:: NYD986905974	***515 MONTGOMERY ST***	***NNW 1/8 - 1/4 (0.239 mi.)***	***T101***	***515***

RCRA-VSQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Very small quantity generators (VSQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-VSQG list, as provided by EDR, and dated 06/03/2024 has revealed that there are 2 RCRA-VSQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT EPA ID:: NYR000164129	101-102 DYER COURT	E 1/8 - 1/4 (0.187 mi.)	P81	394

Lower Elevation	Address	Direction / Distance	Map ID	Page
FAMILY DOLLAR #5071 EPA ID:: NYR000211730	***945 S SALINA ST***	***SW 1/8 - 1/4 (0.181 mi.)***	***L78***	***364***

Lists of state- and tribal hazardous waste facilities

NY SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Conservation's Inactive Hazardous waste Disposal Sites in New York State.

A review of the NY SHWS list, as provided by EDR, and dated 08/01/2024 has revealed that there are 3 NY SHWS sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
NM - SYRACUSE ERIE B Site Code: 56354	***300 ERIE BLVD WEST***	***NW 1/2 - 1 (0.806 mi.)***	***169***	***887***

Lower Elevation	Address	Direction / Distance	Map ID	Page
SOUTH SALINA SIDA Site Code: 422215	1016-1018 MONTGOMERY	SSW 1/8 - 1/4 (0.224 mi.)	V98	511
FORMER BROWN MANUFAC Site Code: 465076	***101 CHESTER STREET***	***SW 1/2 - 1 (0.734 mi.)***	***167***	***851***

Lists of state and tribal leaking storage tanks

NY LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the NY LTANKS list, as provided by EDR, and dated 07/30/2024 has revealed that there are

EXECUTIVE SUMMARY

47 NY LTANKS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
S STATE STREET Spill Number/Closed Date: 9208359 / 1993-01-26 Site ID: 229077 Spill Date: 1992-10-19	S STATE ST/NEW STREE	SSW 0 - 1/8 (0.046 mi.)	B12	33
STEAM PLANT Spill Number/Closed Date: 9908800 / 1999-11-23 Site ID: 259520 Spill Date: 1999-10-20	MCBRIDE ST	SE 0 - 1/8 (0.095 mi.)	G24	52
SALVATION ARMY Spill Number/Closed Date: 0404882 / 2005-03-04 Site ID: 61010 Spill Date: 2004-08-04	***1105 SOUTH STATE ST***	***S 0 - 1/8 (0.096 mi.)***	***E29***	***58***
SYRACUSE UNIVERSITY Spill Number/Closed Date: 8605131 / 1988-01-15 Spill Number/Closed Date: 8605148 / 1988-01-15 Site ID: 229011 Site ID: 229012 Spill Date: 1986-11-11	***500 EAST TAYLOR ST***	***SE 0 - 1/8 (0.116 mi.)***	***G50***	***121***
CENTRO PARKING INC. Spill Number/Closed Date: 9311487 / 2001-02-12 Site ID: 323404 Spill Date: 1993-12-23	SUNY HEALTH SRV. CEN	NNE 1/8 - 1/4 (0.158 mi.)	64	322
NIAGARA MOHAWK POWER Spill Number/Closed Date: 9409889 / 1995-04-18 Site ID: 327666 Spill Date: 1994-10-24	***235 OAKWOOD AVE. EXT***	***SSE 1/8 - 1/4 (0.183 mi.)***	***79***	***367***
HUTCHINGS PSYCH CENT Spill Number/Closed Date: 0211660 / 2004-11-26 Site ID: 187125 Spill Date: 2003-02-24	***620 MADISON STREET***	***NE 1/4 - 1/2 (0.348 mi.)***	***129***	***721***
SUNY HEALTH SCIENCE Spill Number/Closed Date: 1406531 / 2015-07-22 Site ID: 500005 Spill Date: 2014-09-19	***750 EAST ADAMS STREE***	***ENE 1/4 - 1/2 (0.353 mi.)***	***133***	***735***
HUTCHINGS PSYCHIATRI Spill Number/Closed Date: 9809684 / 2003-10-31 Site ID: 121287 Spill Date: 1998-11-02	BLDG 11	NE 1/4 - 1/2 (0.373 mi.)	AF136	757
CLARK HALL; CROUSE I Spill Number/Closed Date: 8709940 / 1988-04-12 Site ID: 114725 Spill Date: 1988-02-18	ELIZABETH BLACKWELL	ENE 1/4 - 1/2 (0.383 mi.)	140	761
PRESIDENTIAL PLAZA Spill Number/Closed Date: 8906852 / 1989-10-12 Site ID: 297379 Spill Date: 1989-10-12	90 PRESIDENTIAL PLAZ	NNE 1/4 - 1/2 (0.385 mi.)	AH142	763
V.A. MEDICAL CENTER Spill Number/Closed Date: 0402165 / 2004-09-29	800 IRIVING AVENUE	ESE 1/4 - 1/2 (0.391 mi.)	AI145	766

Spill Number/Closed Date: 9807877 / 2002-08-06
Site ID: 242917
Site ID: 242920
Spill Date: 2004-05-27
Spill Date: 1998-09-28

PRESIDENTIAL PLAZA | PRESIDENTIAL PLAZA | NNE 1/4 - 1/2 (0.393 mi.) | AH146 | 767
Spill Number/Closed Date: 9407228 / 2002-08-06
Site ID: 250694
Spill Date: 1994-07-08

MEDICAL RESEARCH BLD | 625 MADISON STREET | NE 1/4 - 1/2 (0.409 mi.) | 147 | 769
Spill Number/Closed Date: 0411489 / 2005-04-14
Site ID: 336700
Spill Date: 2005-01-25

743 IRVING AVE. | 743 IRVING AVE | E 1/4 - 1/2 (0.414 mi.) | AJ149 | 772
Spill Number/Closed Date: 9101558 / 1991-05-08
Site ID: 180766
Spill Date: 1991-05-08

CASTLE REST NURSE HO | 401 E CASTLE ST | SSE 1/4 - 1/2 (0.418 mi.) | AK150 | 773
Spill Number/Closed Date: 9011086 / 1991-01-31
Site ID: 149961
Spill Date: 1991-01-18

HUTCHINGS PSYCH CENT | 540 CEDAR - BUILDING | NE 1/4 - 1/2 (0.419 mi.) | 152 | 775
Spill Number/Closed Date: 8802339 / 1990-01-24
Spill Number/Closed Date: 8710954 / 1988-06-09
Site ID: 78437
Site ID: 203614
Spill Date: 1988-06-15
Spill Date: 1988-03-31

CARRIER DOME | FOSTER DRIVE | ESE 1/4 - 1/2 (0.423 mi.) | AL153 | 811
Spill Number/Closed Date: 8903207 / 1989-09-27
Site ID: 331199
Spill Date: 1989-06-27

SYRACUSE UNIV | 900 IRVING AVE | ESE 1/4 - 1/2 (0.428 mi.) | AL156 | 831
Spill Number/Closed Date: 0210237 / 2003-10-31
Site ID: 96874
Spill Date: 2003-01-10

FORMER ACCURATE DIE | 547 EAST GENESEE STR | NNE 1/4 - 1/2 (0.441 mi.) | AO160 | 841
Spill Number/Closed Date: 9416408 / 1996-01-01
Site ID: 129682
Spill Date: 1995-03-20

MARKS HOTEL | ALMOND/E GENESSE ST | NNE 1/4 - 1/2 (0.445 mi.) | 162 | 843
Spill Number/Closed Date: 0202485 / 2002-09-09
Site ID: 220960
Spill Date: 2002-06-07

N.Y. TELE. - FAYETTE | FAYETTE ST & STATE S | N 1/4 - 1/2 (0.486 mi.) | 163 | 845
Spill Number/Closed Date: 8605899 / 1989-12-31
Site ID: 313598
Spill Date: 1986-12-16

CASTLE REST NURSING | 116 EAST CASTLE ST | S 1/4 - 1/2 (0.488 mi.) | AP164 | 847
Spill Number/Closed Date: 9900884 / 2000-03-20
Site ID: 166430

Spill Date: 1999-04-23

SPILL NUMBER 9710355	***713 EAST GENESEE ST***	***NNE 1/4 - 1/2 (0.490 mi.)***	***166***	***849***
Spill Number/Closed Date: 9703897 / 2001-02-12 Site ID: 167465 Spill Date: 1997-06-30				

Lower Elevation	Address	Direction / Distance	Map ID	Page
ONONDAGA CO. HEALTH	STATE STREET SITE	NNW 0 - 1/8 (0.072 mi.)	F18	44
Spill Number/Closed Date: 9108484 / 1992-04-15 Site ID: 188210 Spill Date: 1991-08-23				
ADAMS & STATE ST. GA	ADAMS & STATE STREET	NNW 0 - 1/8 (0.081 mi.)	F23	51
Spill Number/Closed Date: 9108385 / 1991-11-07 Site ID: 210798 Spill Date: 1991-11-06				
HARRISON PL & E ADAM	HARRISON PL & E ADAM	NW 1/8 - 1/4 (0.160 mi.)	65	323
Spill Number/Closed Date: 9814193 / 1999-04-26 Site ID: 97685 Spill Date: 1999-02-25				
680 SOUTH SALINA ST	***680 SOUTH SALINA ST***	***W 1/8 - 1/4 (0.181 mi.)***	***N74***	***348***
Spill Number/Closed Date: 1600634 / 2019-12-10 Spill Number/Closed Date: 8705408 / 1987-10-28 Site ID: 525912 Site ID: 265820 Spill Date: 2016-04-18 Spill Date: 1987-09-28				
SPILL NUMBER 8601815	600 S. STATE ST @ CI	N 1/4 - 1/2 (0.252 mi.)	104	524
Spill Number/Closed Date: 8601815 / 1988-01-15 Site ID: 137258 Spill Date: 1986-06-16				
HARRISON PARKING GAR	WARREN & HARRISON ST	NW 1/4 - 1/2 (0.256 mi.)	W105	525
Spill Number/Closed Date: 9010749 / 1999-11-26 Site ID: 121632 Spill Date: 1991-01-05				
RENALLI TAYLOR ST LL	***140 CORTLAND AVE***	***SW 1/4 - 1/2 (0.279 mi.)***	***X108***	***529***
Spill Number/Closed Date: 9604373 / 1996-07-02 Site ID: 156885 Spill Date: 1996-07-01				
S&F AUTOMOTIVE	420 ONEIDA ST	WSW 1/4 - 1/2 (0.292 mi.)	113	653
Spill Number/Closed Date: 9207347 / 1992-10-05 Site ID: 194355 Spill Date: 1992-09-24				
MONTGOMERY STREET	MONGOMERY ST AND MAD	NNW 1/4 - 1/2 (0.293 mi.)	Z114	654
Spill Number/Closed Date: 0310457 / 2003-12-15 Site ID: 316015 Spill Date: 2003-12-10				
DISTRICT HEATING & C	***601 S STATE ST***	***N 1/4 - 1/2 (0.307 mi.)***	***AB118***	***662***
Spill Number/Closed Date: 8602554 / 1988-12-12 Site ID: 93875 Spill Date: 1986-07-18				
CATHEDRAL IMMACULATE	420 MONTGOMERY AVE	NNW 1/4 - 1/2 (0.309 mi.)	Z120	676

Spill Number/Closed Date: 8709428 / 1988-02-05
Site ID: 317505
Spill Date: 1988-02-05

BYRNE DAIRY INC.	***240 ONEIDA STREET***	***W 1/4 - 1/2 (0.312 mi.)***	***121***	***677***

Spill Number/Closed Date: 9703387 / 1997-06-30
Spill Number/Closed Date: 8708332 / 1988-02-04
Spill Number/Closed Date: 9804457 / 2000-11-08
Site ID: 109079
Site ID: 168673
Site ID: 64142
Spill Date: 1997-06-11
Spill Date: 1987-12-28
Spill Date: 1998-07-09

HOTEL SYRACUSE	***500 S WARREN ST***	***NNW 1/4 - 1/2 (0.333 mi.)***	***AC124***	***691***

Spill Number/Closed Date: 9810139 / 2000-04-24
Site ID: 295387
Spill Date: 1998-11-11

BYRNE DAIRY	KING ST	WSW 1/4 - 1/2 (0.336 mi.)	AD125	708

Spill Number/Closed Date: 0211606 / 2003-07-30
Site ID: 109545
Spill Date: 2003-02-22

BYRNE DAIRY	235 KING STREET	WSW 1/4 - 1/2 (0.336 mi.)	AD126	709

Spill Number/Closed Date: 8603904 / 1988-01-15
Site ID: 198191
Spill Date: 1986-09-16

MONDO'S	***1127 SOUTH SALINA ST***	***SSW 1/4 - 1/2 (0.342 mi.)***	***AE128***	***711***

Spill Number/Closed Date: 8403634 / 1991-06-17
Site ID: 302125
Spill Date: 1985-03-25

MONDO'S SERVICE STAT	1133 SOUTH SALINA	SSW 1/4 - 1/2 (0.349 mi.)	AE131	733

Spill Number/Closed Date: 0703031 / 2007-10-04
Site ID: 382878
Spill Date: 2007-06-13

ATLAS SERVICES	TAYLOR ST; KING ST	WSW 1/4 - 1/2 (0.363 mi.)	AD134	755

Spill Number/Closed Date: 8707432 / 1988-01-05
Site ID: 243223
Spill Date: 1987-11-25

H.S.M.PACKAGING CORP	123 LARNED ST	W 1/4 - 1/2 (0.381 mi.)	AG137	758

Spill Number/Closed Date: 9605294 / 1996-09-30
Site ID: 228231
Spill Date: 1996-07-24

NYS ARMORY JEFFERSON	JEFFERSON ST. ARMORY	N 1/4 - 1/2 (0.383 mi.)	139	760

Spill Number/Closed Date: 9110102 / 1992-01-08
Site ID: 114453
Spill Date: 1991-12-19

CNY CENTRO INC.	***200 CORTLAND AVE.***	***SSW 1/4 - 1/2 (0.425 mi.)***	***AM154***	***812***

Spill Number/Closed Date: 9413883 / 2002-08-06
Spill Number/Closed Date: 9508450 / 1995-10-11
Site ID: 230780
Site ID: 230781
Spill Date: 1995-01-18

Spill Date: 1995-10-11

CENTRAL BUS CNYRTA M ***200 CORTLAND AVE*** ***SSW 1/4 - 1/2 (0.425 mi.)*** ***AM155*** ***827***
Spill Number/Closed Date: 9213577 / 1995-12-28
Site ID: 275090
Spill Date: 1993-03-09

SPILL NUMBER 9908209 ***377 WEST ONONDAGA ST*** ***W 1/4 - 1/2 (0.431 mi.)*** ***AN157*** ***834***
Spill Number/Closed Date: 9908209 / 2000-01-31
Site ID: 153747
Spill Date: 1999-10-06

Lists of state and tribal registered storage tanks

NY UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the NY UST list, as provided by EDR, has revealed that there are 13 NY UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
NY1-1 PIONEER HOMES Database: UST, Date of Government Version: 03/19/2024	ADAMS/RENWICK/TAYLOR	0 - 1/8 (0.000 mi.)	1	9
THE SALVATION ARMY Database: UST, Date of Government Version: 03/19/2024	1105 S. STATE ST	S 0 - 1/8 (0.096 mi.)	E25	53
FORMER SALVATION ARM Database: UST, Date of Government Version: 03/19/2024	1117 SOUTH STATE ST	S 0 - 1/8 (0.107 mi.)	I41	91
SYRACUSE UNIVERSITY Database: UST, Date of Government Version: 03/19/2024	***500 EAST TAYLOR ST***	***SE 0 - 1/8 (0.116 mi.)***	***G54***	***232***
SCHC COMPANIES, INC. Database: UST, Date of Government Version: 03/19/2024	800 S. SALINA ST	WSW 1/8 - 1/4 (0.169 mi.)	M70	335
CENTRAL GARAGE Database: UST, Date of Government Version: 03/19/2024	700-712 S. TOWNSEND	NNE 1/8 - 1/4 (0.188 mi.)	Q83	398

Lower Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE POLICE DEPT Database: UST, Date of Government Version: 03/19/2024	916 S STATE ST	NNW 0 - 1/8 (0.029 mi.)	A4	15
FIRE STATION #1 Database: UST, Date of Government Version: 03/19/2024	900 SOUTH STATE ST	NNW 0 - 1/8 (0.046 mi.)	A9	24
CENTRAL TECH Database: UST, Date of Government Version: 03/19/2024	285 E. ADAMS ST	NNW 0 - 1/8 (0.097 mi.)	F33	64
CENTRAL VILLAGE HOUS Database: UST, Date of Government Version: 03/19/2024	302 BURT ST	S 1/8 - 1/4 (0.142 mi.)	K59	309
WAREHOUSE Database: UST, Date of Government Version: 03/19/2024	908 MONTGOMERY ST	SSW 1/8 - 1/4 (0.156 mi.)	L63	319
BENJAMIN RUSH CENTER Database: UST, Date of Government Version: 03/19/2024	672 S SALINA ST	W 1/8 - 1/4 (0.181 mi.)	N72	342
CAN AM ALLIANCE CORP Database: UST, Date of Government Version: 03/19/2024	680 SOUTH SALINA ST	W 1/8 - 1/4 (0.181 mi.)	N76	354

NY CBS: These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

A review of the NY CBS list, as provided by EDR, and dated 03/19/2024 has revealed that there are 2 NY CBS sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE UNIVERSITY	***500 EAST TAYLOR STRE***	***SE 0 - 1/8 (0.116 mi.)***	***G48***	***106***
Facility Status: Unregulated/Closed CBS Number: 7-000152 CBS Number: 7-000281				
PROJECT ORANGE	***520 E TAYLOR ST***	***ESE 1/8 - 1/4 (0.194 mi.)***	***R86***	***405***
Facility Status: Unregulated/Closed CBS Number: 7-000230				

NY AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the NY AST list, as provided by EDR, has revealed that there are 6 NY AST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SU CHILLED WATER PLA	***500 E. TAYLOR STREET***	***SE 0 - 1/8 (0.116 mi.)***	***G46***	***100***
Database: AST, Date of Government Version: 03/19/2024 Facility Id: 7-000281				
SYRACUSE UNIVERSITY	***500 EAST TAYLOR STRE***	***SE 0 - 1/8 (0.116 mi.)***	***G48***	***106***
Database: AST, Date of Government Version: 03/19/2024 Facility Id: 7-000152				
SYRACUSE UNIVERSITY	***500 EAST TAYLOR ST***	***SE 0 - 1/8 (0.116 mi.)***	***G54***	***232***
Database: AST, Date of Government Version: 03/19/2024 Facility Id: 7-180602				
PROJECT ORANGE	***520 E TAYLOR ST***	***ESE 1/8 - 1/4 (0.194 mi.)***	***R86***	***405***
Database: AST, Date of Government Version: 03/19/2024 Facility Id: 7-000230				

Lower Elevation	Address	Direction / Distance	Map ID	Page
FIRE STATION #1	900 SOUTH STATE ST	NNW 0 - 1/8 (0.046 mi.)	A11	31
Database: AST, Date of Government Version: 03/19/2024 Facility Id: 7-181935				
NY1-1 PIONEER HOMES	ADAMS/RENWICK/TAYLOR	NNW 0 - 1/8 (0.078 mi.)	F19	45
Database: AST, Date of Government Version: 03/19/2024 Facility Id: 7-498947				

NY CBS AST: Chemical Bulk Storage Database. Registration data collected as required by 6 NYCRR Part 596. It includes facilities storing hazardous substances listed in 6 NYCRR Part 597, in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size. Includes facilities registered (and closed) since effective date of CBS regulations (July 15, 1988) through the date request is processed.

A review of the NY CBS AST list, as provided by EDR, and dated 01/01/2002 has revealed that there are

3 NY CBS AST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SU CHILLED WATER PLA	***500 E. TAYLOR STREET***	***SE 0 - 1/8 (0.116 mi.)***	***G46***	***100***
Facility Status: 2 Facility Status: 1 CBS Number: 7-000281				
SYRACUSE UNIVERSITY	500 E. TAYLOR STREET	SE 0 - 1/8 (0.116 mi.)	G47	103
Facility Status: 1 Facility Status: 1 CBS Number: 7-000152				
PROJECT ORANGE	***520 E TAYLOR ST***	***ESE 1/8 - 1/4 (0.194 mi.)***	***R86***	***405***
Facility Status: 1 Facility Status: 1 CBS Number: 7-000230				

State and tribal institutional control / engineering control registries

NY ENG CONTROLS: Environmental Remediation sites that have engineering controls in place.

A review of the NY ENG CONTROLS list, as provided by EDR, and dated 08/01/2024 has revealed that there are 2 NY ENG CONTROLS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MCKINNEY PROPERTY	***1226 SOUTH MCBRIDE S***	***SE 1/8 - 1/4 (0.130 mi.)***	***J57***	***259***
Site Code: 57334				

Lower Elevation	Address	Direction / Distance	Map ID	Page
FORMER COYNE TEXTILE	***140 CORTLAND AVENUE***	***SW 1/4 - 1/2 (0.279 mi.)***	***X109***	***581***
Site Code: 507968				

Environmental Remediation sites that have institutional controls in place.

A review of the NY INST CONTROL list, as provided by EDR, and dated 08/01/2024 has revealed that there are 2 NY INST CONTROL sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MCKINNEY PROPERTY	***1226 SOUTH MCBRIDE S***	***SE 1/8 - 1/4 (0.130 mi.)***	***J57***	***259***
Site Code: 57334				

Lower Elevation	Address	Direction / Distance	Map ID	Page
FORMER COYNE TEXTILE	***140 CORTLAND AVENUE***	***SW 1/4 - 1/2 (0.279 mi.)***	***X109***	***581***
Site Code: 507968				

Lists of state and tribal brownfield sites

NY BROWNFIELDS: Brownfields Site List

A review of the NY BROWNFIELDS list, as provided by EDR, and dated 08/01/2024 has revealed that there are 8 NY BROWNFIELDS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
EAST ADAMS REDEVELOP Site Code: 659420	1105-1117 SOUTH STAT	S 0 - 1/8 (0.096 mi.)	E31	60

Lower Elevation	Address	Direction / Distance	Map ID	Page
EAST ADAMS REDEVELOP Site Code: 658151	100 ANGELOU TERRACE	NNW 0 - 1/8 (0.023 mi.)	A2	11
EAST ADAMS REDEVELOP Site Code: 657340	300 BURT STREET	S 1/8 - 1/4 (0.143 mi.)	K61	312
RENALLI TAYLOR ST LL Site Code: 580830	***140 CORTLAND AVE***	***SW 1/4 - 1/2 (0.279 mi.)***	***X108***	***529***
FORMER COYNE TEXTILE Site Code: 507968	***140 CORTLAND AVENUE***	***SW 1/4 - 1/2 (0.279 mi.)***	***X109***	***581***
SOUTH SALINA STREET Site Code: 570636	***1081 SOUTH SALINA ST***	***SSW 1/4 - 1/2 (0.285 mi.)***	***Y112***	***646***
CHIMES BUILDING Site Code: 662655	500-550 SOUTH SALINA	WNW 1/4 - 1/2 (0.295 mi.)	AA116	658
JMA CAMPUS PLAN Site Code: 667687	623 ONEIDA STREET	SW 1/4 - 1/2 (0.349 mi.)	130	731

NY ERP: In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a $200 million Environmental Restoration or Brownfields Fund as part of the $1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

A review of the NY ERP list, as provided by EDR, and dated 08/01/2024 has revealed that there is 1 NY ERP site within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MCKINNEY PROPERTY Site Code: 57334	***1226 SOUTH MCBRIDE S***	***SE 1/8 - 1/4 (0.130 mi.)***	***J57***	***259***

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: The EPA's listing of Brownfields properties from the Cleanups in My Community program, which provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

A review of the US BROWNFIELDS list, as provided by EDR, and dated 03/11/2024 has revealed that there are 5 US BROWNFIELDS sites within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
1045-1047 SOUTH SALI	***1045 SOUTH SALINA ST***	***SSW 1/8 - 1/4 (0.247 mi.)***	***V103***	***521***
1049-1071 SOUTH SALI	***1049-1071 SOUTH SALI***	***SSW 1/4 - 1/2 (0.263 mi.)***	***V107***	***527***
1073-1079 SOUTH SALI	***1073-1079 SOUTH SALI***	***SSW 1/4 - 1/2 (0.280 mi.)***	***Y110***	***641***
1081-1085 SOUTH SALI	***1081-1085 SOUTH SALI***	***SSW 1/4 - 1/2 (0.285 mi.)***	***Y111***	***644***
1101-1111 SOUTH SALI	***1101-1111 SOUTH SALI***	***SSW 1/4 - 1/2 (0.293 mi.)***	***Y115***	***655***

Records of Emergency Release Reports

NY Spills: Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, and dated 07/30/2024 has revealed that there are 19 NY Spills sites within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
PARKING LOT- 111 RAD Spill Number/Closed Date: 2005041 / 2022-05-13 Site ID: 610813 Spill Date: 2020-09-01	111 RADISON CT	ESE 0 - 1/8 (0.056 mi.)	C14	38
DABLON COURT Spill Number/Closed Date: 9401370 / 1994-04-28 Site ID: 139643 Spill Date: 1994-04-27	DABLON COURT (PIONEE	NE 0 - 1/8 (0.062 mi.)	D16	42
CITY OWNED APARTMENT Spill Number/Closed Date: 2400040 / Not Reported Site ID: 664372 Spill Date: 2024-04-02	301-311 EAST TAYLOR	S 0 - 1/8 (0.065 mi.)	E17	43
SPILL NUMBER 8601904 Spill Number/Closed Date: 8601904 / 1987-08-11 Site ID: 142087 Spill Date: 1986-06-19	1105 SOUTH STATE ST	S 0 - 1/8 (0.096 mi.)	E28	57
SALVATION ARMY Spill Number/Closed Date: 9711143 / 2002-08-06 Site ID: 61011 Spill Date: 1998-01-05	***1105 SOUTH STATE ST***	***S 0 - 1/8 (0.096 mi.)***	***E29***	***58***
PIONEER HOMES	MONROE ST	ENE 0 - 1/8 (0.102 mi.)	35	68

Spill Number/Closed Date: 9612304 / 1997-06-30
Site ID: 310416
Spill Date: 1996-12-01

INTERSECTION OF — EAST TAYLOR/SOUTH MC — SE 0 - 1/8 (0.109 mi.) — G42 — 95
Spill Number/Closed Date: 0600689 / 2006-04-19
Site ID: 362754
Spill Date: 2006-04-18

TAYLOR & MCBRIDE ST. — TAYLOR AND MCBRIDE S — SE 0 - 1/8 (0.112 mi.) — G43 — 96
Spill Number/Closed Date: 9107234 / 1991-11-12
Site ID: 284835
Spill Date: 1991-10-05

E. TAYLOR AND MCBRID — EAST TAYLOR AND MCBR — SE 0 - 1/8 (0.112 mi.) — G44 — 97
Spill Number/Closed Date: 9204042 / 1992-07-08
Site ID: 238382
Spill Date: 1992-07-08

STEAM HEAT SYR. UNIV — TALOR & MCBRIDE ST — ESE 0 - 1/8 (0.116 mi.) — G45 — 98
Spill Number/Closed Date: 8801654 / 1995-02-09
Site ID: 257809
Spill Date: 1988-05-23

SYRACUSE UNIVERSITY — ***500 EAST TAYLOR STRE*** — ***SE 0 - 1/8 (0.116 mi.)*** — ***G48*** — ***106***
Spill Number/Closed Date: 1902943 / 2020-03-27
Spill Number/Closed Date: 9008107 / 1990-10-24
Site ID: 590889
Site ID: 161896
Spill Date: 2019-06-21
Spill Date: 1990-10-24

STEAM STATION — 500 EAST TAYLOR ST — SE 0 - 1/8 (0.116 mi.) — G49 — 120
Spill Number/Closed Date: 1810736 / 2019-03-26
Site ID: 581643
Spill Date: 2019-01-23

SYRACUSE UNIVERSITY — ***500 EAST TAYLOR ST*** — ***SE 0 - 1/8 (0.116 mi.)*** — ***G50*** — ***121***
Spill Number/Closed Date: 8910992 / 1990-07-09
Spill Number/Closed Date: 1206833 / 2012-12-04
Spill Number/Closed Date: 0407665 / 2004-10-13
Site ID: 161895
Site ID: 469851
Site ID: 332190
Spill Date: 1990-02-17
Spill Date: 2012-10-11
Spill Date: 2004-10-11

SYRACUSE UNIV STEAM — 500 EAST TAYLOR ST — SE 0 - 1/8 (0.116 mi.) — G53 — 230
Spill Number/Closed Date: 1502394 / 2016-04-08
Site ID: 508657
Spill Date: 2015-06-03

Lower Elevation	Address	Direction / Distance	Map ID	Page
MANHOLE 7-1 Spill Number/Closed Date: 2400382 / 2024-04-15 Site ID: 666699 Spill Date: 2024-04-11	907 SOUTH TOWNSEND S	NNE 0 - 1/8 (0.057 mi.)	D15	40
EAST COLVIN AND	STATE STREET	NNW 0 - 1/8 (0.079 mi.)	F20	48

Spill Number/Closed Date: 9608949 / 1996-11-18
Site ID: 231429
Spill Date: 1996-10-18

PARKING GARAGE	STATE ST & ADAMS ST	NNW 0 - 1/8 (0.081 mi.)	F22	50
Spill Number/Closed Date: 9111803 / 1992-03-12 Site ID: 295517 Spill Date: 1992-02-17				
INSTITUTE OF TECHNOL	258 EAST ADAMS ST	NW 0 - 1/8 (0.102 mi.)	H36	69
Spill Number/Closed Date: 1303516 / 2014-07-29 Site ID: 484000 Spill Date: 2013-07-02				
ONON.CO. PARKING GAR	ADDAMS ST	N 0 - 1/8 (0.105 mi.)	F39	89
Spill Number/Closed Date: 9206683 / 1992-09-16 Site ID: 289096 Spill Date: 1992-09-09				

Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 06/03/2024 has revealed that there are 14 RCRA NonGen / NLR sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE UNIVERSITY- EPA ID:: NYD982271918	***500 EAST TAYLOR ST***	***SE 0 - 1/8 (0.116 mi.)***	***G52***	***214***
MC BRIDE SUB EPA ID:: NYD980782775	***S MCBRIDE***	***SE 1/8 - 1/4 (0.137 mi.)***	***G58***	***303***
SCHC CO INC CORP OFF EPA ID:: NY0001039767	***800 S SALINA ST***	***WSW 1/8 - 1/4 (0.169 mi.)***	***M68***	***328***
SCHC COMPANIES INC EPA ID:: NYD001039767	***800 S SALINA ST***	***WSW 1/8 - 1/4 (0.169 mi.)***	***M69***	***331***
PROJECT ORANGE EPA ID:: NYD987016136	***520 E TAYLOR ST***	***ESE 1/8 - 1/4 (0.194 mi.)***	***R86***	***405***
NYSDOT BIN 1031569 EPA ID:: NY0000202481	***I-81/EAST ADAMS STRE***	***ESE 1/8 - 1/4 (0.201 mi.)***	***P91***	***472***
SYRACUSE HOUSING AUT EPA ID:: NYD981873599	***516 BURT ST***	***SE 1/8 - 1/4 (0.213 mi.)***	***92***	***479***

Lower Elevation	Address	Direction / Distance	Map ID	Page
NIAGARA MOHAWK, A NA EPA ID:: NYP000976662	***SOUTH STATE STREET***	***NNW 0 - 1/8 (0.046 mi.)***	***A10***	***27***
INSTITUTE OF TECHNOL	***258 E ADAMS ST***	***NW 0 - 1/8 (0.102 mi.)***	***H38***	***75***

EPA ID:: NYD986981520				
ONONDAGA CO CONVENTI	***S STATE ST***	***NNW 0 - 1/8 (0.125 mi.)***	***55***	***240***
EPA ID:: NYD986937431				
NIAGARA MOHAWK A NAT	***400 HARRISON ST***	***N 1/8 - 1/4 (0.184 mi.)***	***O80***	***391***
EPA ID:: NYP000968313				
NIAGARA MOHAWK A NAT	S STATE ST & HARRISO	N 1/8 - 1/4 (0.188 mi.)	O85	403
EPA ID:: NYP000973675				
SYRACUSE COMMUNITY H	***819 S SALINA ST***	***SW 1/8 - 1/4 (0.198 mi.)***	***S88***	***464***
EPA ID:: NYR000142984				
AMERICAN RED CROSS	***636 S WARREN ST***	***NW 1/8 - 1/4 (0.223 mi.)***	***U97***	***503***
EPA ID:: NYR000020446				

UST FINDER RELEASE: US EPA's UST Finder data is a national composite of leaking underground storage tanks. This data contains information about, and locations of, leaking underground storage tanks. Data was collected from state sources and standardized into a national profile by EPA's Office of Underground Storage Tanks, Office of Research and Development, and the Association of State and Territorial Solid Waste Management Officials.

A review of the UST FINDER RELEASE list, as provided by EDR, and dated 06/08/2023 has revealed that there are 23 UST FINDER RELEASE sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FORMER SALVATION ARM	1105 SOUTH STATE ST	S 0 - 1/8 (0.096 mi.)	E26	55
SALVATION ARMY	1105 SOUTH STATE ST	S 0 - 1/8 (0.096 mi.)	E30	60
HUTCHINGS	500 CEDAR ST	NE 1/4 - 1/2 (0.367 mi.)	AF135	756
PRESIDENTIAL PLAZA	90 PRESIDENTIAL PLAZ	NNE 1/4 - 1/2 (0.385 mi.)	AH141	762
V.A. MEDICAL CENTER	800 IRIVING AVENUE	ESE 1/4 - 1/2 (0.391 mi.)	AI144	765
743 IRVING AVE.	743 IRVING AVE	E 1/4 - 1/2 (0.414 mi.)	AJ148	771
CASTLE REST NURSE HO	401 E CASTLE ST	SSE 1/4 - 1/2 (0.418 mi.)	AK151	774
FORMER ACCURATE DIE	547 EAST GENESEE STR	NNE 1/4 - 1/2 (0.441 mi.)	AO161	842
SPILL NUMBER 9900884	116 EAST CASTLE ST	S 1/4 - 1/2 (0.488 mi.)	AP165	849

Lower Elevation	Address	Direction / Distance	Map ID	Page
ADAMS & STATE ST. GA	ADAMS & STATE STREET	NNW 0 - 1/8 (0.081 mi.)	F21	49
DESIMONES SERVICE ST	680 S. SALINA ST	W 1/8 - 1/4 (0.181 mi.)	N75	353
HARRISON CONVENTION	HARRISON & MONTGOMER	NNW 1/8 - 1/4 (0.200 mi.)	T90	471
HARRISON PARKING GAR	WARREN & HARRISON ST	NW 1/4 - 1/2 (0.256 mi.)	W106	526
500 SOUTH SALINA STR	500 SOUTH SALINA STR	WNW 1/4 - 1/2 (0.295 mi.)	AA117	661
STEAM STATION-S.STAT	601 S. STATE ST	N 1/4 - 1/2 (0.307 mi.)	AB119	675
COUNTY SEWER ROW	CLINTON AND WEST ONO	WNW 1/4 - 1/2 (0.326 mi.)	AA122	689
500 WARREN ST	500 WARREN ST	NNW 1/4 - 1/2 (0.333 mi.)	AC123	690
MONDO'S AGWAY	1127 SO. SALINA ST	SSW 1/4 - 1/2 (0.342 mi.)	AE127	710
MONDO'S SERVICE STAT	1133 SOUTH SALINA	SSW 1/4 - 1/2 (0.349 mi.)	AE132	734
H.S.M.PACKAGING CORP	123 LARNED ST	W 1/4 - 1/2 (0.381 mi.)	AG138	759
ATLAS LINEN	320 WEST TAYLOR ST	WSW 1/4 - 1/2 (0.388 mi.)	143	764
ELEVATOR SHAFT	377 WEST ONONDAGA ST	W 1/4 - 1/2 (0.431 mi.)	AN158	840
SPILL NUMBER 9908209	377 WEST ONONDAGA ST	W 1/4 - 1/2 (0.431 mi.)	AN159	841

EXECUTIVE SUMMARY

UST FINDER: EPA developed UST Finder, a web map application containing a comprehensive, state-sourced national map of underground storage tank (UST) and leaking UST (LUST) data. It provides the attributes and locations of active and closed USTs, UST facilities, and LUST sites from states and from Tribal lands and US territories . UST Finder contains information about proximity of UST facilities and LUST sites to: surface and groundwater public drinking water protection areas; estimated number of private domestic wells and number of people living nearby; and flooding and wildfires.

A review of the UST FINDER list, as provided by EDR, and dated 06/08/2023 has revealed that there are 10 UST FINDER sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
THE SALVATION ARMY	1105 S. STATE ST	S 0 - 1/8 (0.096 mi.)	E27	56
SYRACUSE UNIVERSITY	500 EAST TAYLOR ST	SE 0 - 1/8 (0.116 mi.)	G51	212
SCHC COMPANIES, INC.	800 S. SALINA ST	WSW 1/8 - 1/4 (0.169 mi.)	M67	326
CENTRAL GARAGE	700-712 S. TOWNSEND	NNE 1/8 - 1/4 (0.188 mi.)	Q82	396

Lower Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE POLICE DEPT	916 S STATE ST	NNW 0 - 1/8 (0.029 mi.)	A3	14
FIRE STATION #1	900 SOUTH STATE ST	NNW 0 - 1/8 (0.046 mi.)	A7	22
CENTRAL TECH	285 E. ADAMS ST	NNW 0 - 1/8 (0.097 mi.)	F32	63
CENTRAL VILLAGE HOUS	302 BURT ST	S 1/8 - 1/4 (0.142 mi.)	K60	311
BENJAMIN RUSH CENTER	672 S SALINA ST	W 1/8 - 1/4 (0.181 mi.)	N71	340
JUPP CORP	680 SOUTH SALINA ST	W 1/8 - 1/4 (0.181 mi.)	N73	345

E MANIFEST: EPA established a national system for tracking hazardous waste shipments electronically. This system, known as ?e-Manifest,? will modernize the nation?s cradle-to-grave hazardous waste tracking process while saving valuable time, resources, and dollars for industry and states.

A review of the E MANIFEST list, as provided by EDR, and dated 07/24/2023 has revealed that there are 4 E MANIFEST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE UNIVERSITY-	***500 EAST TAYLOR ST***	***SE 0 - 1/8 (0.116 mi.)***	***G52***	***214***
SYRACUSE HOUSING AUT	***1207 ALMOND ST***	***ESE 1/8 - 1/4 (0.220 mi.)***	***R94***	***490***

Lower Elevation	Address	Direction / Distance	Map ID	Page
NIAGARA MOHAWK, A NA	***SOUTH STATE STREET***	***NNW 0 - 1/8 (0.046 mi.)***	***A10***	***27***
224 HARRISON ST ASSO	224 HARRISON ST	NW 1/8 - 1/4 (0.225 mi.)	W99	512

NY MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the NY MANIFEST list, as provided by EDR, and dated 12/31/2019 has revealed that there are 23 NY MANIFEST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT EPA ID: NYR000154476	***116-118 RADISSON COU***	***ESE 0 - 1/8 (0.049 mi.)***	***C13***	***34***
SYRACUSE UNIVERSITY EPA ID: NYD982271918	***500 EAST TAYLOR STRE***	***SE 0 - 1/8 (0.116 mi.)***	***G48***	***106***
SYRACUSE HOUSING AUT	***409 BURT STREET***	***SSE 1/8 - 1/4 (0.125 mi.)***	***J56***	***247***

EPA ID: NY0000201889				
MC BRIDE SUB EPA ID: NYD980782775	***S MCBRIDE***	***SE 1/8 - 1/4 (0.137 mi.)***	***G58***	***303***
SYRACUSE HOUSING AUT EPA ID: NYR000154492	***120-122 TYLER COURT***	***ENE 1/8 - 1/4 (0.150 mi.)***	***62***	***314***
SCHC COMPANIES INC EPA ID: NYD001039767	***800 S SALINA ST***	***WSW 1/8 - 1/4 (0.169 mi.)***	***M69***	***331***
NIAGARA MOHAWK POWER EPA ID: NYD980788442	***235 OAKWOOD AVE. EXT***	***SSE 1/8 - 1/4 (0.183 mi.)***	***79***	***367***
PROJECT ORANGE EPA ID: NYD987016136	***520 E TAYLOR ST***	***ESE 1/8 - 1/4 (0.194 mi.)***	***R86***	***405***
NYSDOT BIN 1031569 EPA ID: NY0000202481	***I-81/EAST ADAMS STRE***	***ESE 1/8 - 1/4 (0.201 mi.)***	***P91***	***472***
SYRACUSE HOUSING AUT EPA ID: NYD981873599	***516 BURT ST***	***SE 1/8 - 1/4 (0.213 mi.)***	***92***	***479***
SYRACUSE HOUSING AUT EPA ID: NYR000154468	***1207 ALMOND ST***	***ESE 1/8 - 1/4 (0.220 mi.)***	***R94***	***490***

Lower Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT EPA ID: NYR000171124	***218 NEW ST***	***WSW 0 - 1/8 (0.040 mi.)***	***B5***	***18***
NIAGARA MOHAWK A NAT EPA ID: NYP000976662	900 SOUTH STATE STRE	NNW 0 - 1/8 (0.046 mi.)	A8	23
INSTITUTE OF TECHNOL EPA ID: NYD986981520	***258 E ADAMS ST***	***NW 0 - 1/8 (0.102 mi.)***	***H38***	***75***
ONONDAGA CO CONVENTI EPA ID: NYD986937431	***S STATE ST***	***NNW 0 - 1/8 (0.125 mi.)***	***55***	***240***
FAMILY DOLLAR #5071 EPA ID: NYR000211730	945 S SALINA ST	SW 1/8 - 1/4 (0.181 mi.)	L77	361
NIAGARA MOHAWK A NAT EPA ID: NYP000968313	***400 HARRISON ST***	***N 1/8 - 1/4 (0.184 mi.)***	***O80***	***391***
NIAGARA MOHAWK A NAT EPA ID: NYP000973675	S STATE ST & HARRISO	N 1/8 - 1/4 (0.188 mi.)	O84	401
SYRACUSE COMMUNITY H EPA ID: NYR000199190	***930 S SALINA ST***	***SW 1/8 - 1/4 (0.198 mi.)***	***S87***	***456***
SYRACUSE COMMUNITY H EPA ID: NYR000142984	***819 S SALINA ST***	***SW 1/8 - 1/4 (0.198 mi.)***	***S88***	***464***
AMERICAN RED CROSS EPA ID: NYD986901312	***636 SOUTH WARREN ST***	***NW 1/8 - 1/4 (0.223 mi.)***	***U96***	***498***
AMERICAN RED CROSS EPA ID: NYR000020446	***636 S WARREN ST***	***NW 1/8 - 1/4 (0.223 mi.)***	***U97***	***503***
ONONDAGA COUNTY OF EPA ID: NYD986905974	515 MONTGOMERY ST	NNW 1/8 - 1/4 (0.239 mi.)	T102	519

NJ MANIFEST: Hazardous waste manifest information.

A review of the NJ MANIFEST list, as provided by EDR, and dated 12/31/2018 has revealed that there is 1 NJ MANIFEST site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE UNIVERSITY- EPA Id: NYD982271918	***500 EAST TAYLOR ST***	***SE 0 - 1/8 (0.116 mi.)***	***G52***	***214***

PA MANIFEST: Hazardous waste manifest information.

A review of the PA MANIFEST list, as provided by EDR, and dated 06/30/2018 has revealed that there are 6 PA MANIFEST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT Generator EPA Id: NY0000201889	BURT & MCBRIDE ST	SE 1/8 - 1/4 (0.162 mi.)	66	325
SYRACUSE HOUSING AUT Generator EPA Id: NYR000154468	1207 ALMOND STREET	ESE 1/8 - 1/4 (0.220 mi.)	R93	489

Lower Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT Generator EPA Id: NYR000171124	218 NEW STREET	WSW 0 - 1/8 (0.040 mi.)	B6	21
SYRACUSE CITY SCHOOL Generator EPA Id: NYD986981520	258 E ADAMS ST	NW 0 - 1/8 (0.102 mi.)	H37	70
SYRACUSE COMMUNITY H Generator EPA Id: NYR000142984	819 SOUTH SALINA STR	SW 1/8 - 1/4 (0.198 mi.)	S89	470
ONONDAGA COUNTY WAR Generator EPA Id: NYD986905974	515 MONTGOMERY STREE	NNW 1/8 - 1/4 (0.239 mi.)	T100	514

NY MGP: From the late 1800's to the mid 1900's, hundreds of manufactured gas plants across New York State supplied homes and industry with fuel for heating, cooking, and lighting. Today, the New York State DEC is overseeing the investigation and cleanup of contamination left behind from these plants.

A review of the NY MGP list, as provided by EDR, and dated 03/04/2024 has revealed that there is 1 NY MGP site within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
NM - SYRACUSE ERIE B	***300 ERIE BLVD WEST***	***NW 1/2 - 1 (0.806 mi.)***	***169***	***887***

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EXECUTIVE SUMMARY

EDR MGP: The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

A review of the EDR MGP list, as provided by EDR, has revealed that there is 1 EDR MGP site within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
NIMO - SYRACUSE - ER	300 ERIC BLVD WEST	NNW 1/2 - 1 (0.771 mi.)	168	887

EDR Hist Auto: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Auto list, as provided by EDR, has revealed that there is 1 EDR Hist Auto site within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
DI PINO ANTHONY	1117 SOUTH STATE ST	S 0 - 1/8 (0.107 mi.)	I40	90

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 7 records.

Site Name	Database(s)
ROTONDO WAREHOUSE	NY SHWS, NY HSWDS
SIDA PROPERTIES	NY SHWS
OLD TIP-TOP BAKERY	NY SHWS
NIAGARA MOHAWK /NM HQ	SEMS-ARCHIVE
W.JEFFERSON ST. ROADWAY&ROW(400 OF	NY VCP, NY BROWNFIELDS
FORM. DUPLI GRAPHICS FACILITY(400	NY VCP, NY BROWNFIELDS
SPILL NUMBER 8601051	NY LTANKS

OVERVIEW MAP - 7748282.2S

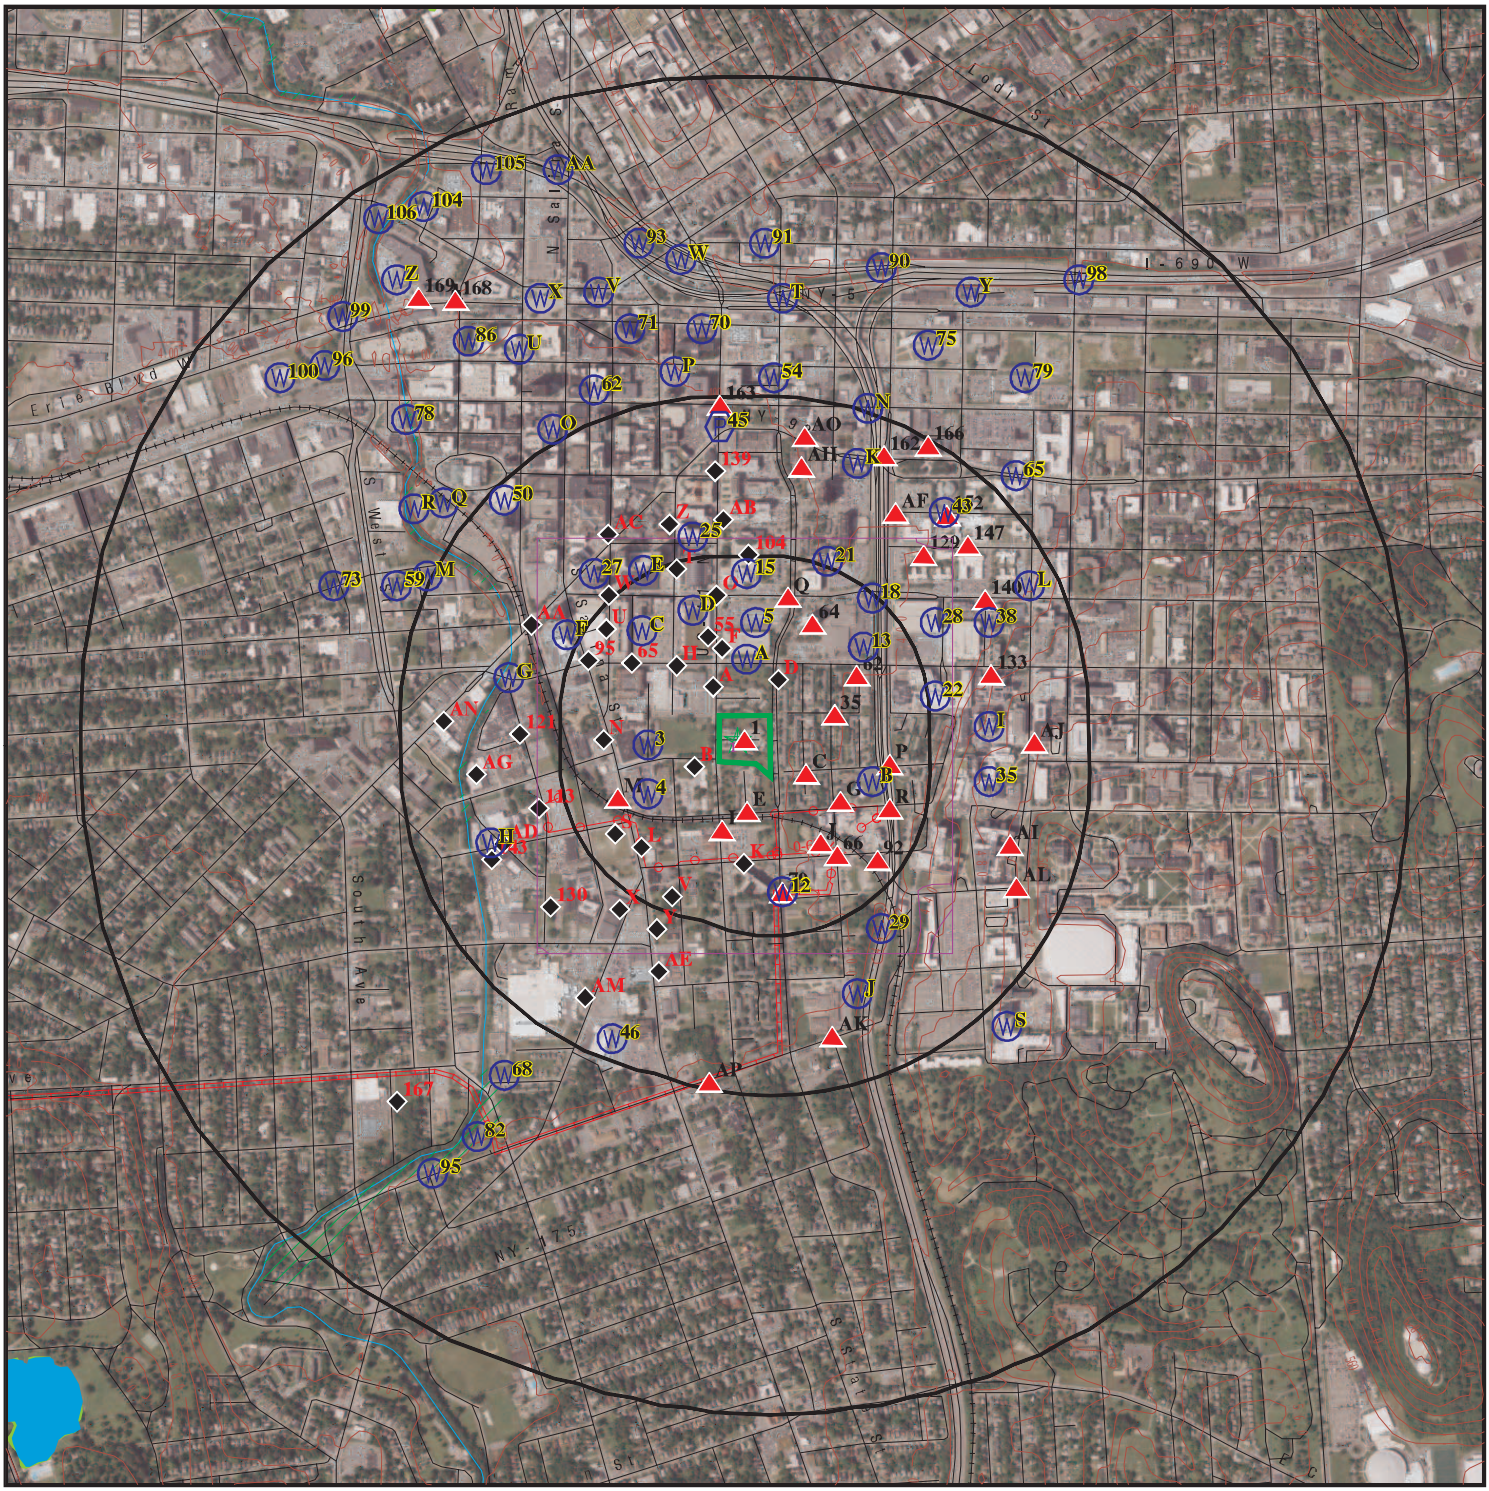

- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- National Priority List Sites
- Dept. Defense Sites

0 1/4 1/2 1 Miles

- Indian Reservations BIA
- Power transmission lines
- Pipelines
- Special Flood Hazard Area (1%)
- 0.2% Annual Chance Flood Hazard
- National Wetland Inventory
- State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME:	East Adams Redevelopment Phase Three Area	CLIENT:	Langan Engineering, Inc.
ADDRESS:	200 Chavez Terrace Syracuse NY 13202	CONTACT:	Sarah Gardner
LAT/LONG:	43.040957 / 76.146874	INQUIRY #:	7748282.2s
		DATE:	August 28, 2024 12:46 pm

Copyright © 2024 EDR, Inc. © 2015 TomTom Rel. 2015.

DETAIL MAP - 7748282.2S

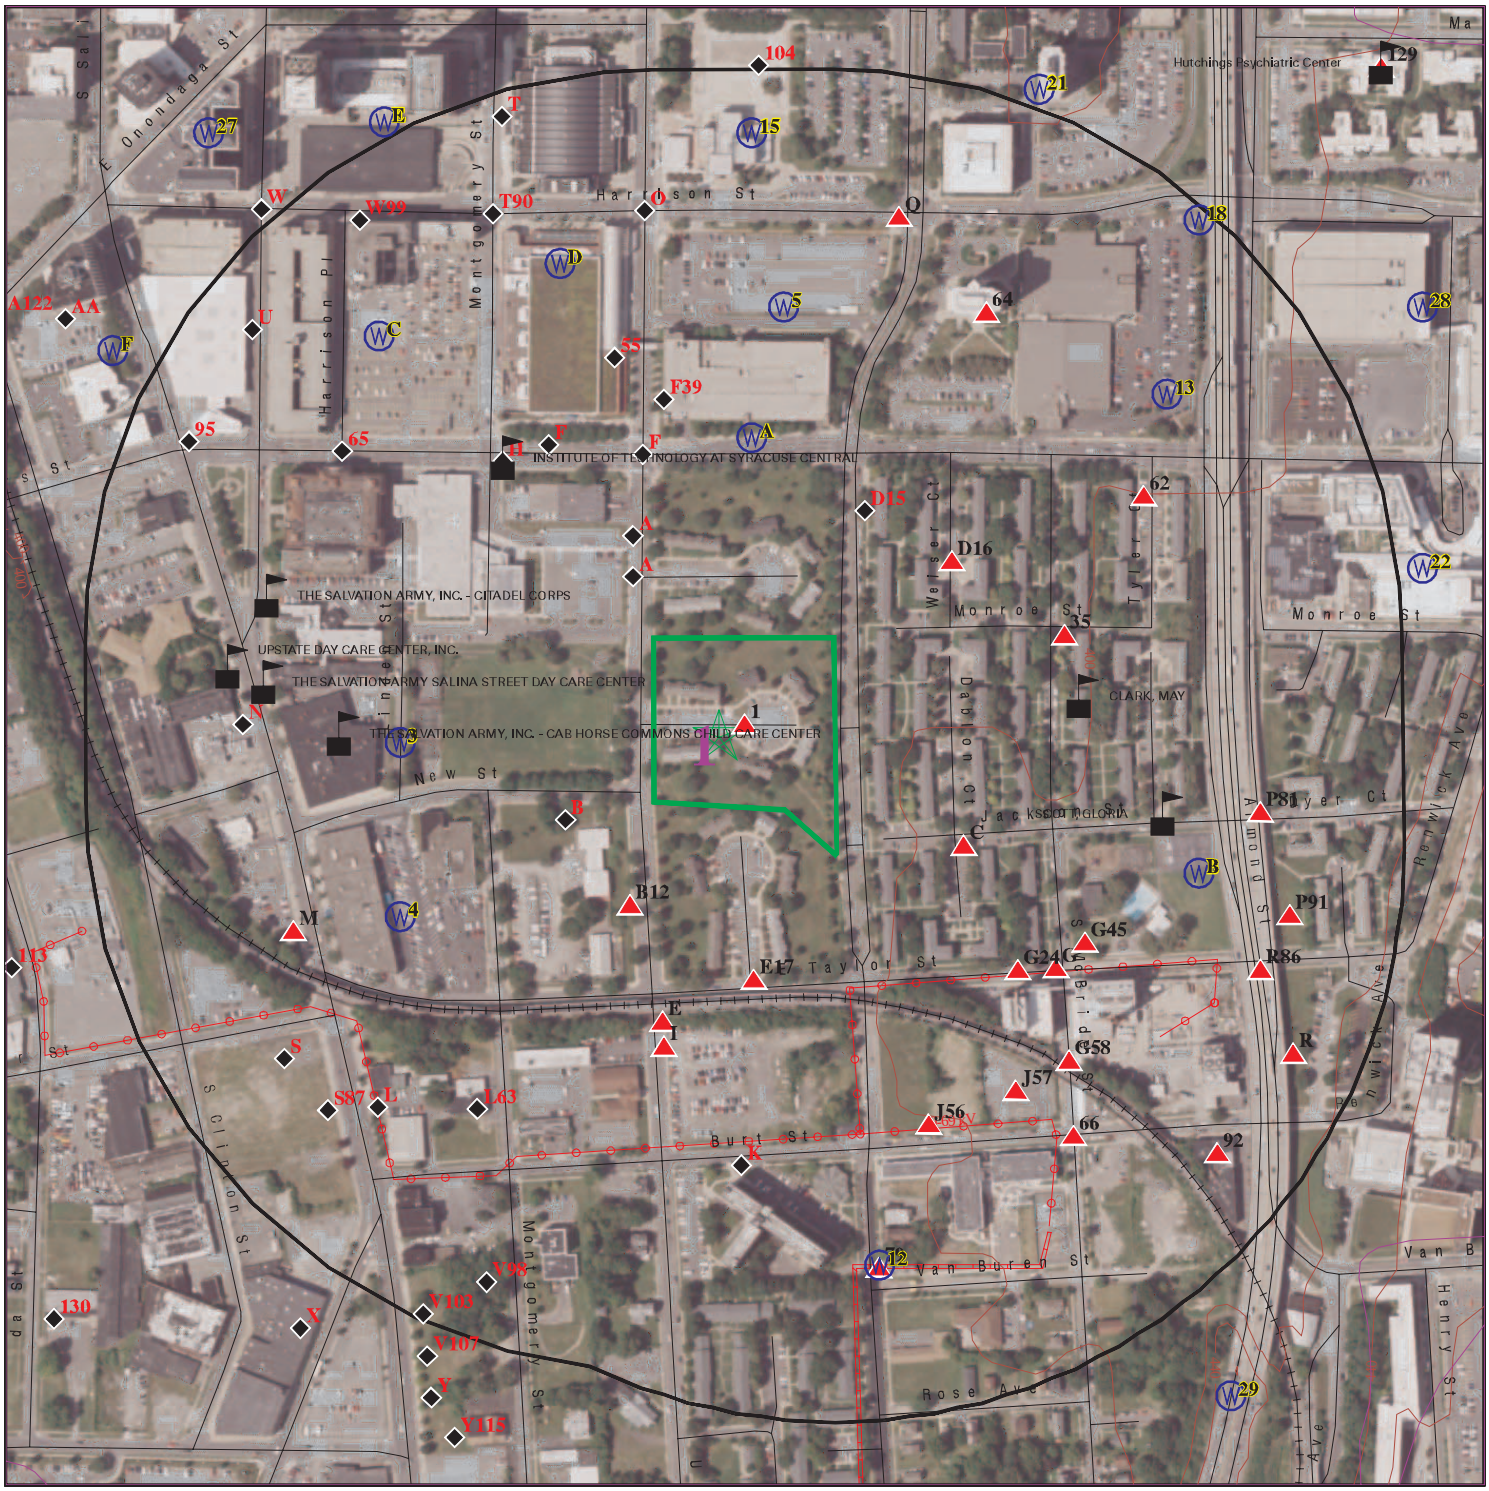

Target Property

Sites at elevations higher than or equal to the target property

Sites at elevations lower than the target property

Manufactured Gas Plants

Sensitive Receptors

National Priority List Sites

Dept. Defense Sites

0 1/16 1/8 1/4 Miles

Indian Reservations BIA

Power transmission lines

Pipelines

Special Flood Hazard Area (1%)

0.2% Annual Chance Flood Hazard

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME:	East Adams Redevelopment Phase Three Area	CLIENT:	Langan Engineering, Inc.
ADDRESS:	200 Chavez Terrace Syracuse NY 13202	CONTACT:	Sarah Gardner
		INQUIRY #:	7748282.2s
LAT/LONG:	43.040957 / 76.146874	DATE:	August 28, 2024 12:48 pm

Copyright © 2024 EDR, Inc. © 2015 TomTom Rel. 2015.

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
Lists of Federal NPL (Superfund) sites								
NPL	1.000		0	0	0	0	NR	0
Proposed NPL	1.000		0	0	0	0	NR	0
NPL LIENS	1.000		0	0	0	0	NR	0
Lists of Federal Delisted NPL sites								
Delisted NPL	1.000		0	0	0	0	NR	0
Lists of Federal sites subject to CERCLA removals and CERCLA orders								
FEDERAL FACILITY	0.500		0	0	0	NR	NR	0
SEMS	0.500		0	0	0	NR	NR	0
Lists of Federal CERCLA sites with NFRAP								
SEMS-ARCHIVE	0.500		1	0	0	NR	NR	1
Lists of Federal RCRA facilities undergoing Corrective Action								
CORRACTS	1.000		0	0	0	0	NR	0
Lists of Federal RCRA TSD facilities								
RCRA-TSDF	0.500		0	0	0	NR	NR	0
Lists of Federal RCRA generators								
RCRA-LQG	0.250		0	1	NR	NR	NR	1
RCRA-SQG	0.250		2	5	NR	NR	NR	7
RCRA-VSQG	0.250		0	2	NR	NR	NR	2
Federal institutional controls / engineering controls registries								
LUCIS	0.500		0	0	0	NR	NR	0
US ENG CONTROLS	0.500		0	0	0	NR	NR	0
US INST CONTROLS	0.500		0	0	0	NR	NR	0
Federal ERNS list								
ERNS	0.001		0	NR	NR	NR	NR	0
Lists of state- and tribal hazardous waste facilities								
NY SHWS	1.000		0	1	0	2	NR	3
Lists of state and tribal landfills and solid waste disposal facilities								
NY SWF/LF	0.500		0	0	0	NR	NR	0
Lists of state and tribal leaking storage tanks								
INDIAN LUST	0.500		0	0	0	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
NY LTANKS	0.500		6	4	37	NR	NR	47
NY HIST LTANKS	0.500		0	0	0	NR	NR	0
Lists of state and tribal registered storage tanks								
FEMA UST	0.250		0	0	NR	NR	NR	0
NY UST	0.250		7	6	NR	NR	NR	13
NY CBS UST	0.250		0	0	NR	NR	NR	0
NY MOSF UST	0.500		0	0	0	NR	NR	0
NY CBS	0.250		1	1	NR	NR	NR	2
NY MOSF	0.500		0	0	0	NR	NR	0
NY AST	0.250		5	1	NR	NR	NR	6
NY CBS AST	0.250		2	1	NR	NR	NR	3
NY MOSF AST	0.500		0	0	0	NR	NR	0
INDIAN UST	0.250		0	0	NR	NR	NR	0
NY TANKS	0.250		0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
NY RES DECL	0.125		0	NR	NR	NR	NR	0
NY ENG CONTROLS	0.500		0	1	1	NR	NR	2
NY INST CONTROL	0.500		0	1	1	NR	NR	2
Lists of state and tribal voluntary cleanup sites								
NY VCP	0.500		0	0	0	NR	NR	0
INDIAN VCP	0.500		0	0	0	NR	NR	0
Lists of state and tribal brownfield sites								
NY BROWNFIELDS	0.500		2	1	5	NR	NR	8
NY ERP	0.500		0	1	0	NR	NR	1
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.500		0	1	4	NR	NR	5
Local Lists of Landfill / Solid Waste Disposal Sites								
NY SWRCY	0.500		0	0	0	NR	NR	0
NY SWTIRE	0.500		0	0	0	NR	NR	0
INDIAN ODI	0.500		0	0	0	NR	NR	0
DEBRIS REGION 9	0.500		0	0	0	NR	NR	0
ODI	0.500		0	0	0	NR	NR	0
IHS OPEN DUMPS	0.500		0	0	0	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US HIST CDL	0.001		0	NR	NR	NR	NR	0
NY DEL SHWS	1.000		0	0	0	0	NR	0
US CDL	0.001		0	NR	NR	NR	NR	0
Local Lists of Registered Storage Tanks								
NY HIST UST	0.250		0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
NY HIST AST	0.001		0	NR	NR	NR	NR	0
Local Land Records								
NY LIENS	0.001		0	NR	NR	NR	NR	0
LIENS 2	0.001		0	NR	NR	NR	NR	0
Records of Emergency Release Reports								
HMIRS	0.001		0	NR	NR	NR	NR	0
NY Spills	0.125		19	NR	NR	NR	NR	19
NY Hist Spills	0.125		0	NR	NR	NR	NR	0
NY SPILLS 90	0.125		0	NR	NR	NR	NR	0
NY SPILLS 80	0.125		0	NR	NR	NR	NR	0
Other Ascertainable Records								
RCRA NonGen / NLR	0.250		4	10	NR	NR	NR	14
FUDS	1.000		0	0	0	0	NR	0
DOD	1.000		0	0	0	0	NR	0
SCRD DRYCLEANERS	0.500		0	0	0	NR	NR	0
US FIN ASSUR	0.001		0	NR	NR	NR	NR	0
EPA WATCH LIST	0.001		0	NR	NR	NR	NR	0
2020 COR ACTION	0.250		0	0	NR	NR	NR	0
TSCA	0.001		0	NR	NR	NR	NR	0
TRIS	0.001		0	NR	NR	NR	NR	0
SSTS	0.001		0	NR	NR	NR	NR	0
ROD	1.000		0	0	0	0	NR	0
RMP	0.001		0	NR	NR	NR	NR	0
RAATS	0.001		0	NR	NR	NR	NR	0
PRP	0.001		0	NR	NR	NR	NR	0
PADS	0.001		0	NR	NR	NR	NR	0
ICIS	0.001		0	NR	NR	NR	NR	0
FTTS	0.001		0	NR	NR	NR	NR	0
MLTS	0.001		0	NR	NR	NR	NR	0
COAL ASH DOE	0.001		0	NR	NR	NR	NR	0
COAL ASH EPA	0.500		0	0	0	NR	NR	0
PCB TRANSFORMER	0.001		0	NR	NR	NR	NR	0
RADINFO	0.001		0	NR	NR	NR	NR	0
HIST FTTS	0.001		0	NR	NR	NR	NR	0
DOT OPS	0.001		0	NR	NR	NR	NR	0
CONSENT	1.000		0	0	0	0	NR	0
INDIAN RESERV	1.000		0	0	0	0	NR	0
FUSRAP	1.000		0	0	0	0	NR	0
UMTRA	0.500		0	0	0	NR	NR	0
LEAD SMELTERS	0.001		0	NR	NR	NR	NR	0
US AIRS	0.001		0	NR	NR	NR	NR	0
US MINES	0.250		0	0	NR	NR	NR	0
MINES MRDS	0.250		0	0	NR	NR	NR	0
ABANDONED MINES	0.250		0	0	NR	NR	NR	0
FINDS	0.001		0	NR	NR	NR	NR	0
ECHO	0.001		0	NR	NR	NR	NR	0
DOCKET HWC	0.001		0	NR	NR	NR	NR	0
UXO	1.000		0	0	0	0	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
FUELS PROGRAM	0.250		0	0	NR	NR	NR	0
PFAS NPL	0.250		0	0	NR	NR	NR	0
PFAS FEDERAL SITES	0.250		0	0	NR	NR	NR	0
PFAS TRIS	0.250		0	0	NR	NR	NR	0
PFAS TSCA	0.250		0	0	NR	NR	NR	0
PFAS RCRA MANIFEST	0.250		0	0	NR	NR	NR	0
PFAS ATSDR	0.250		0	0	NR	NR	NR	0
PFAS WQP	0.250		0	0	NR	NR	NR	0
PFAS PROJECT	0.250		0	0	NR	NR	NR	0
PFAS NPDES	0.250		0	0	NR	NR	NR	0
PFAS ECHO	0.250		0	0	NR	NR	NR	0
PFAS ECHO FIRE TRAIN	0.250		0	0	NR	NR	NR	0
PFAS PT 139 AIRPORT	0.250		0	0	NR	NR	NR	0
AQUEOUS FOAM NRC	0.250		0	0	NR	NR	NR	0
BIOSOLIDS	0.001		0	NR	NR	NR	NR	0
UST FINDER RELEASE	0.500		3	2	18	NR	NR	23
UST FINDER	0.250		5	5	NR	NR	NR	10
E MANIFEST	0.250		2	2	NR	NR	NR	4
NY PFAS	0.250		0	0	NR	NR	NR	0
NY AIRS	0.001		0	NR	NR	NR	NR	0
NY COAL ASH	0.500		0	0	0	NR	NR	0
NY DRYCLEANERS	0.250		0	0	NR	NR	NR	0
NY E DESIGNATION	0.125		0	NR	NR	NR	NR	0
NY Financial Assurance	0.001		0	NR	NR	NR	NR	0
NY HSWDS	0.500		0	0	0	NR	NR	0
NY LEAD	0.001		0	NR	NR	NR	NR	0
NY MANIFEST	0.250		6	17	NR	NR	NR	23
RI MANIFEST	0.250		0	0	NR	NR	NR	0
NJ MANIFEST	0.250		1	0	NR	NR	NR	1
PA MANIFEST	0.250		2	4	NR	NR	NR	6
NY SPDES	0.001		0	NR	NR	NR	NR	0
NY VAPOR REOPENED	0.500		0	0	0	NR	NR	0
NY UIC	0.001		0	NR	NR	NR	NR	0
NY COOLING TOWERS	0.001		0	NR	NR	NR	NR	0
NY NYC OER	1.000		0	0	0	0	NR	0
NY MGP	1.000		0	0	0	1	NR	1
NY ILI	0.500		0	0	0	NR	NR	0
NY NYC LAND USE	0.001		0	NR	NR	NR	NR	0
EDR HIGH RISK HISTORICAL RECORDS								
EDR Exclusive Records								
EDR MGP	1.000		0	0	0	1	NR	1
EDR Hist Auto	0.125		1	NR	NR	NR	NR	1
EDR Hist Cleaner	0.125		0	NR	NR	NR	NR	0
EDR RECOVERED GOVERNMENT ARCHIVES								
Exclusive Recovered Govt. Archives								
NY RGA HWS	0.001		0	NR	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
NY RGA LF	0.001		0	NR	NR	NR	NR	0
- Totals --		0	69	67	66	4	0	206

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

1 **NY1-1 PIONEER HOMES** **NY UST** **U004079888**
ADAMS/RENWICK/TAYLOR/STATE **N/A**
< 1/8 **SYRACUSE, NY 13202**
1 ft.

Relative: Higher

Actual: 398 ft.

UST:

Name:	NY1-1 PIONEER HOMES
Address:	ADAMS/RENWICK/TAYLOR/STATE
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-498947 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	406600.05465
UTM Y:	4766007.99600
Site Type:	Apartment Building/Office Building

Affiliation Records:

Site Id:	46336
Affiliation Type:	Mail Contact
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	ANDREW BARSUCH
Address1:	516 BURT ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 475-6181
EMail:	ABARSUCH@SYRHOUSING.ORG
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2011-01-14

Site Id:	46336
Affiliation Type:	Facility Operator
Company Name:	NY1-1 PIONEER HOMES
Contact Type:	Not reported
Contact Name:	GREG PALMER
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 706-3727
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2011-01-14

Site Id:	46336
Affiliation Type:	Emergency Contact
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	ANDREW BARSUCH
Address1:	Not reported
Address2:	Not reported

NY1-1 PIONEER HOMES (Continued) **U004079888**

City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(315) 439-4788
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2011-01-14

Site Id:	46336
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	EXECUTIVE DIRECTOR
Contact Name:	WILLIAM SIMMONS
Address1:	516 BURT ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 475-6181
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2011-01-14

Tank Info:

Tank Number:	003
Tank ID:	133569
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	5000
Install Date:	12/01/1984
Date Tank Closed:	04/01/1994
Registered:	True
Tank Location:	Underground
Tank Type:	Fiberglass coated steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
B04 - Tank External Protection - Fiberglass
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

NY1-1 PIONEER HOMES (Continued) **U004079888**

J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None

Tank Number:	004
Tank ID:	133570
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	10000
Install Date:	12/01/1984
Date Tank Closed:	11/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Fiberglass coated steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
B04 - Tank External Protection - Fiberglass
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

A2 **EAST ADAMS REDEVELOPMENT - PHASE I AREA** **NY BROWNFIELDS** **S131764059**
NNW **100 ANGELOU TERRACE** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.023 mi.
122 ft. **Site 1 of 8 in cluster A**

Relative: **Lower**

Actual: **397 ft.**

BROWNFIELDS:

Name:	EAST ADAMS REDEVELOPMENT - PHASE I AREA
Address:	100 ANGELOU TERRACE
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	658151
Acres:	3.280
HW Code:	C734162
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	10/19/2023
Record Updated Date:	03/21/2024
Update By:	LSZINOMA
Site Description:	"03/20/2024 Site was denied from the Brownfield Cleanup Program (BCP). Based upon review of the BCP application, the proposed site is not a brownfield site as defined in Article 27, Title 14 of the Environmental Conservation Law. Location: The site is located at 100

EAST ADAMS REDEVELOPMENT - PHASE I AREA (Continued) **S131764059**

Angelou Terrace within an urban, mixed-use area in the City of Syracuse, New York. The site is located in the northern portion of an about 11.10-acre tax parcel, identified as Onondaga County Tax Parcel 095.-08-01.0. The site is bound by East Adams Street followed by a parking garage at 817-835 South State Street to the north, South Townsend Street followed by a residential building at 1031-1059 South Townsend Street and Adams Street to the east, residential buildings at 301 311 East Taylor Street to the south, and South State Street followed by a fire station at 900 South State Street and an institutional building at 701 South Warren Street to the west. The site is improved with six, two-story multi-unit residential buildings and associated asphalt-paved parking lots and access roadways in the south-central part of the site. The remainder of the site is comprised of landscaped areas. The area surrounding the site consists of residential, commercial, institutional, and industrial properties. Site Features: According to the May 2023 Phase I Environmental Site Assessment (ESA) and the July 2023 Phase II ESA prepared by EA engineering, P.C. and Its Affiliate EA Science and Technology (EA), the elevation of the site is about elevation (el) 398 feet1. The topography of the site is generally flat with the surrounding area gently sloping towards the west. Current Zoning and Land Use: According to the Rezone Syracuse ordinance and City of Syracuse Zoning Map, the site is located within an MX-2: Neighborhood Center District. The MX-2: Neighborhood Center zoning district is generally characterized as pedestrian-friendly, transit-supportive mix of medium to higher density residential uses and non-residential uses that offer goods and services to surrounding neighborhoods. The surrounding properties are zoned for MX-2: Neighborhood Center Districts, MX-3: Mixed-Use Transition, MX-5: Central Business District, LI: Light Industrial and Employment, and OS: Open Space. Land use within a half-mile radius is urban and includes residential, commercial, institutional/public services, industrial, vacant land, and public parks. The nearest ecological receptor is the Onondaga Creek, located approximately 0.4 miles west of the site. At present, the site is occupied by six residential buildings, asphalt-paved parking lots and access roadways, and landscaped areas. Past Use of the Site: Historical documents indicate that the site has been located in a residential and commercial area since as early as 1892. By 1892, the site was developed with several one- to two-story dwellings and a one-story church in the southeastern part of the site. Historical uses of the site also included a fire department (1910 to 1953), junk yard (1910 to 1961), church (1961 to 1982), a gym and auditorium (1951 to 1961), and auto parking (1951). By 1989, the site was occupied by the Syracuse Housing Authority and developed in its present-day configuration. Site Geology and Hydrogeology: According to the U.S. Department of Agriculture s (USDA) Natural Resources Conservation Service (NRCS) Soil Survey Geographic (SSURGO) data for the site, soils at the site are comprised primarily of urban land. Urban land is described as excavated, filled, and made land. According to the Phase II ESA conducted by EA, soil at the site consists of historic fill comprised primarily of brown sand, silt, and clay with varying amounts of gravel, clay, brick, asphalt, glass, and tile to about 3 feet below grade surface (bgs). This layer is underlain by brown to gray silt and clay, fine-grained sand, and gravel to the termination depth of the borings (about 15 feet bgs). Bedrock was not encountered during the investigation. Based on review of the Geologic Map of New York, Finger Lakes Sheet (Fisher,

EAST ADAMS REDEVELOPMENT - PHASE I AREA (Continued) **S131764059**

	Isachsen, Rickard, dated March 1970) , the site is underlain by bedrock of the Syracuse Foundation, consisting of dolostone, shale, gypsum and salt. Based on measurements collected during the Phase II ESA conducted by EA, groundwater at the site flows to the northwest, following the local topography, towards Onondaga Creek. Groundwater was observed at about 7.3 to 10.3 feet bgs (corresponding to el. 395.21 to el. 390.23). "
Env Problem:	"Information submitted with the BCP application regarding the environmental condition at the site are currently under review and will be revised as additional information becomes available."
Health Problem:	"Information submitted with the BCP application regarding the conditions at the site are currently under review and will be revised as additional information becomes available."
Dump:	Not reported
Structure:	Not reported
Lagoon:	Not reported
Landfill:	Not reported
Pond:	Not reported
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	Not reported
Record Upd:	Not reported
Updated By:	Not reported
Own Op:	1
Sub Type:	NNN
Owner Name:	William J Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Allyson Carpenter
Owner Company:	East Adams Phase I. L.P.
Owner Address:	100 North Broadway, Suite 100
Owner Addr2:	Not reported
Owner City,St,Zip:	St. Louis, MO 63102
Owner Country:	United States of America
Own Op:	4
Sub Type:	NNN
Owner Name:	William J Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Rene Battelle
Owner Company:	Onondaga County Public Libraries-Central Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America

EAST ADAMS REDEVELOPMENT - PHASE I AREA (Continued) **S131764059**

HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	Not reported
Cross Ref Type Code:	Not reported
Cross Ref Type:	Not reported
Record Added Date:	Not reported
Record Updated:	Not reported
Updated By:	Not reported

A3 **SYRACUSE POLICE DEPT GAS DEPOT** **UST FINDER** **1028588826**
NNW **916 S STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.029 mi.
151 ft. **Site 2 of 8 in cluster A**

Relative: **Lower**
Actual: **396 ft.**

UST FINDER:

Object ID:	318245
Facility ID:	NY45027
Name:	SYRACUSE POLICE DEPT GAS DEPOT
Address:	916 S STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	2
TOS USTs:	0
Population 1500ft:	1786
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Low Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Closed UST(s)
Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.147611
Y Coord:	43.0408660000001
Latitude:	43.040866
Longitude:	-76.147611

UST FINDER:

Object ID:	1278206
Facility ID:	NY45027
Tank ID:	NY79341
Tank Status:	Closed
Installation Date:	1980/10/01 16:00:00+00
Removal Date:	Not reported

SYRACUSE POLICE DEPT GAS DEPOT (Continued) **1028588826**

Tank Capacity:	10000
Substances:	Not reported
Tank Wall Type:	Not reported
Object ID:	1278207
Facility ID:	NY45027
Tank ID:	NY71200
Tank Status:	Closed
Installation Date:	1980/10/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	10000
Substances:	Not reported
Tank Wall Type:	Not reported

A4 **SYRACUSE POLICE DEPT GAS DEPOT** **NY UST** **U003313254**
NNW **916 S STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.029 mi.
151 ft. **Site 3 of 8 in cluster A**

Relative: **Lower**

Actual: **396 ft.**

UST:

Name:	SYRACUSE POLICE DEPT GAS DEPOT
Address:	916 S STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-181803 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	406521.69565
UTM Y:	4765991.90851
Site Type:	Unknown

Affiliation Records:

Site Id:	45027
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE POLICE DEPT GAS DEPOT
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	511 S STATE ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 425-6165
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04
Site Id:	45027
Affiliation Type:	Mail Contact
Company Name:	SYRACUSE POLICE DEPT GAS DEPOT
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	511 S STATE ST

SYRACUSE POLICE DEPT GAS DEPOT (Continued) **U003313254**

Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 425-6165
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45027
Affiliation Type:	Facility Operator
Company Name:	SYRACUSE POLICE DEPT GAS DEPOT
Contact Type:	Not reported
Contact Name:	SYRACUSE POLICE DEPT GAS DEPOT
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 425-6165
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45027
Affiliation Type:	Emergency Contact
Company Name:	SYRACUSE POLICE DEPT GAS DEPOT
Contact Type:	Not reported
Contact Name:	SYRACUSE POLICE GARAGE
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 425-6165
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Tank Info:

Tank Number:	001
Tank ID:	129827
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	10000
Install Date:	10/01/1980
Date Tank Closed:	09/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel

SYRACUSE POLICE DEPT GAS DEPOT (Continued) **U003313254**

Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None

Tank Number: 002
Tank ID: 129828
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 10000
Install Date: 10/01/1980
Date Tank Closed: 09/01/1993
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

B5 **SYRACUSE HOUSING AUTHORITY BUILDING & GROUNDS** **RCRA-SQG** **1012211705**
WSW **218 NEW ST** **NY MANIFEST** **NYR000171124**
< 1/8 **SYRACUSE, NY 13202**
0.040 mi.
210 ft. **Site 1 of 3 in cluster B**

Relative: **Lower**
Actual: **397 ft.**

RCRA Listings:

Date Form Received by Agency:	20100105
Handler Name:	Syracuse Housing Authority Building & Grounds
Handler Address:	New St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYR000171124
Contact Name:	WILLIAM W GEHRKE
Contact Address:	NEW ST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-470-4315 x4315
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Other
Federal Waste Generator Description:	Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	NEW ST
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Syracuse Housing Authority
Owner Type:	Other
Operator Name:	Syracuse Housing Authority
Operator Type:	Other
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No

SYRACUSE HOUSING AUTHORITY BUILDING & GROUNDS (Continued) **1012211705**

Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D002
Waste Description:	Corrosive Waste

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	SYRACUSE HOUSING AUTHORITY
Legal Status:	Other
Date Became Current:	19890101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	SYRACUSE HOUSING AUTHORITY
Legal Status:	Other
Date Became Current:	19400101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20100105
Handler Name:	SYRACUSE HOUSING AUTHORITY BUILDING & GROUNDS
Federal Waste Generator Description:	Small Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No

SYRACUSE HOUSING AUTHORITY BUILDING & GROUNDS (Continued) **1012211705**

Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 92511
NAICS Description: ADMINISTRATION OF HOUSING PROGRAMS

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

NY MANIFEST:
EPA ID: NYR000171124
Country: USA
Name: SYRACUSE HOUSING AUTHORITY BUILDING & GROUNDS
Address: 218 NEW ST
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported
Location Address 1: 218 NEW ST
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: SYRACUSE HOUSING AUTHORITY BUILDING & GROUNDS
Mailing Contact: MARK DENNY
Mailing Address 1: 516 BURT STREET
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154704315

Manifest Data:
Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NYR000115733
Year: 2018
Trans2 State ID: Not reported
Generator Ship Date: 01/13/2010
Trans1 Recv Date: 01/13/2010
Trans2 Recv Date: Not reported
TSD Site Recv Date: 01/22/2010
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000171124
Trans1 EPA ID: Not reported

SYRACUSE HOUSING AUTHORITY BUILDING & GROUNDS (Continued) **1012211705**

Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	002474327FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	CORROSIVE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	25
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

B6 **SYRACUSE HOUSING AUTHORITY - NEW STREET** **PA MANIFEST** **S111771708**
WSW **218 NEW STREET** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.040 mi.
210 ft. **Site 2 of 3 in cluster B**

Relative: PA MANIFEST:
Lower

Actual:
397 ft.

Name:	SYRACUSE HOUSING AUTHORITY - NEW STREET
Address:	218 NEW STREET
City,State,Zip:	SYRACUSE, NY 13202
Year:	2010
Manifest Number:	002474327FLE
Manifest Type:	T
Generator EPA ID:	NYR000171124
Generator Date:	01/13/2010
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	NULL
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY

SYRACUSE HOUSING AUTHORITY - NEW STREET (Continued) **S111771708**

TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D002
Container Number:	1
Container Type:	DF
Waste Quantity:	25
Unit:	G
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

A7 **FIRE STATION #1** **UST FINDER** **1028588839**
NNW **900 SOUTH STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.046 mi.
242 ft. **Site 4 of 8 in cluster A**

Relative: **Lower**

Actual: **396 ft.**

UST FINDER:

Object ID:	318283
Facility ID:	NY45039
Name:	FIRE STATION #1
Address:	900 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Address Match Type:	Not reported
Open USTs:	1
Closed USTs:	2
TOS USTs:	0
Population 1500ft:	1951
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Open UST(s)
Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.1476049999999
Y Coord:	43.0426610000001
Latitude:	43.042661
Longitude:	-76.147605

UST FINDER:

Object ID:	1278080
Facility ID:	NY45039
Tank ID:	NY75944
Tank Status:	Closed

FIRE STATION #1 (Continued) **1028588839**

Installation Date:	1974/12/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	2000
Substances:	Not reported
Tank Wall Type:	Not reported
Object ID:	1278081
Facility ID:	NY45039
Tank ID:	NY117945
Tank Status:	Closed
Installation Date:	1974/12/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	2000
Substances:	Not reported
Tank Wall Type:	Not reported
Object ID:	1278082
Facility ID:	NY45039
Tank ID:	NY70628
Tank Status:	Open
Installation Date:	1995/05/01 15:59:59+00
Removal Date:	Not reported
Tank Capacity:	2500
Substances:	Not reported
Tank Wall Type:	Not reported

A8 **NIAGARA MOHAWK A NATIONAL GRID COMPANY** **NY MANIFEST** **S130581177**
NNW **900 SOUTH STATE STREET** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.046 mi.
242 ft. **Site 5 of 8 in cluster A**

Relative: **Lower**

Actual: **396 ft.**

NY MANIFEST:

EPA ID:	NYP000976662
Country:	USA
Name:	NIAGARA MOHAWK A NATIONAL GRID COMPANY
Address:	900 SOUTH STATE STREET
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	900 SOUTH STATE STREET
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	NIAGARA MOHAWK A NATIONAL GRID COMPANY
Mailing Contact:	NIAGARA MOHAWK
Mailing Address 1:	300 ERIE BOULEVARD W
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	8008393975

A9
NNW
< 1/8
0.046 mi.
242 ft.

FIRE STATION #1
900 SOUTH STATE ST
SYRACUSE, NY 13202

Site 6 of 8 in cluster A

NY UST **U003313266**
N/A

Relative:
Lower

Actual:
396 ft.

UST:

Name:	FIRE STATION #1
Address:	900 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-181935 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	06/30/2027
UTM X:	406500.41583
UTM Y:	4766163.01145
Site Type:	Municipality (Incl. Waste Water Treatment Plants, Utilities, Swimming Pools, etc.)

Affiliation Records:

Site Id:	45039
Affiliation Type:	Emergency Contact
Company Name:	CITY OF SYRACUSE FIRE DEPT
Contact Type:	Not reported
Contact Name:	CHIEF OF FIRE
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(315) 473-3230
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2013-05-13

Site Id:	45039
Affiliation Type:	Facility Operator
Company Name:	FIRE STATION #1
Contact Type:	Not reported
Contact Name:	JEFF GROSSO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 473-5495
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2019-03-06

Site Id:	45039
Affiliation Type:	Facility Owner
Company Name:	CITY OF SYRACUSE
Contact Type:	DEPUTYCHIEF - SYRACUSE FIRE DEPT
Contact Name:	ZACH SMITH
Address1:	CITY HALL - 233 EAST WASHINGTON ST

FIRE STATION #1 (Continued) **U003313266**

Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 448-8200
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2022-04-26

Site Id:	45039
Affiliation Type:	Mail Contact
Company Name:	CITY OF SYRACUSE FIRE DEPT
Contact Type:	Not reported
Contact Name:	ZACH SMITH
Address1:	FIRE MAINTENANCE
Address2:	312 STATE FAIR BLVD
City:	SYRACUSE
State:	NY
Zip Code:	13204
Country Code:	001
Phone:	(315) 448-4777
EMail:	ZSMITH@SYRGOV.NET
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2022-04-26

Tank Info:

Tank Number:	001
Tank ID:	129862
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	2000
Install Date:	12/01/1974
Date Tank Closed:	05/01/1995
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	0008
Common Name of Substance:	Diesel

Tightness Test Method:	11
Date Test:	05/01/1993
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

I04 - Overfill - Product Level Gauge (A/G)
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel

FIRE STATION #1 (Continued) **U003313266**

F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None

Tank Number:	002
Tank ID:	129863
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	2000
Install Date:	12/01/1974
Date Tank Closed:	05/01/1995
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	0008
Common Name of Substance:	Diesel
Tightness Test Method:	11
Date Test:	05/01/1993
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

A00 - Tank Internal Protection - None
I04 - Overfill - Product Level Gauge (A/G)
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel

Tank Number:	004
Tank ID:	137149
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	2500
Install Date:	05/01/1995
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	0008
Common Name of Substance:	Diesel
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

FIRE STATION #1 (Continued) **U003313266**

A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction Dispenser
F05 - Pipe External Protection - Jacketed
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
B00 - Tank External Protection - None
E04 - Piping Secondary Containment - Double walled UG
G04 - Tank Secondary Containment - Double-Walled (Underground)
H05 - Tank Leak Detection - In-Tank System (ATG)
L02 - Piping Leak Detection - Interstitial - Manual Monitoring

---

A10 **NIAGARA MOHAWK, A NATIONAL GRID COMPANY** **RCRA NonGen / NLR** **1026498246**
NNW **SOUTH STATE STREET** **E MANIFEST** **NYP000976662**
< 1/8 **SYRACUSE, NY 13202**
0.046 mi.
242 ft. **Site 7 of 8 in cluster A**

Relative: **Lower**

Actual: **396 ft.**

RCRA Listings:

Date Form Received by Agency:	20201217
Handler Name:	Niagara Mohawk - A National Grid Co
Handler Address:	South State St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYP000976662
Contact Name:	Not reported
Contact Address:	Not reported
Contact City,State,Zip:	Not reported
Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	Not reported
Mailing City,State,Zip:	Not reported
Owner Name:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No

NIAGARA MOHAWK, A NATIONAL GRID COMPANY (Continued) **1026498246**

Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20220411
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	20200930
Handler Name:	NIAGARA MOHAWK, A NATIONAL GRID COMPANY
Federal Waste Generator Description:	Small Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	No
Electronic Manifest Broker:	No

Receive Date:	20201217
Handler Name:	NIAGARA MOHAWK - A NATIONAL GRID CO
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes

NIAGARA MOHAWK, A NATIONAL GRID COMPANY (Continued) **1026498246**

Non Storage Recycler Activity: No
Electronic Manifest Broker: No

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

E MANIFEST:

Manifest Tracking Number:	006546866GBF
Last Updated Date:	20201111
Shipped Date:	20201027
Received Date:	20201103
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYP000976662
Generator Name:	Niagara Mohawk, A National Grid Company
Generator Mail Street Number:	900
Generator Mail Street 1:	SOUTH STATE STREET
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13202
Generator Location Street Number:	300
Generator Location Street 1:	ERIE BOULEVARD WEST
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location Zip:	13202
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	MID000724831
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	49350 N I-94 SERVICE DR
Designated Facility Mail Street 2:	ATTN SYLWIA SCOTT
Designated Facility Mail City:	BELLEVILLE
Designated Facility Mail Zip:	48111
Designated Facility Mail State:	MI
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	49350 NORTH I94 SERVICE DRIVE
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	BELLEVILLE
Designated Facility Location Zip:	48111
Designated Facility Location State:	MI
Designated Facility Contact Company Name:	MICHIGAN DISPOSAL WASTE TREATMENT PLANT
Manifest Residue Indicator:	N
Rejection Indicator:	N

NIAGARA MOHAWK, A NATIONAL GRID COMPANY (Continued) **1026498246**

Federal Waste:
- Manifest Tracking Number: 006546866GBF
- Waste Line Number: 1
- Federal Waste Code: D008
- Federal Waste: LEAD

Transporter:
- Manifest Tracking Number: 006546866GBF
- Transporter Line Number: 1
- Transporter EPA ID: MAC300098399
- Transporter Name: Nrc East Environmental Services Inc

- Manifest Tracking Number: 006546866GBF
- Transporter Line Number: 2
- Transporter EPA ID: MAD084814136
- Transporter Name: Eq Northeast Inc

Waste Line:
- Manifest Tracking Number: 006546866GBF
- Waste Line Number: 1
- U.S. DOT Hazardous Indicator: Y
- U.S. DOT ID Number: NA3082
- U.S. DOT Description: Na3082, Hazardous Waste, Liquid, N.O.S., 9, Pgiii, Erg#171
- Non-Hazardous Waste Description: Not reported
- Number of Containers: 5
- Container Type Code: DM
- Container Type Description: Metal drums, barrels, kegs
- Waste Quantity: 1500
- Quantity Unit of Measure Code: P
- Quantity Unit of Measure Description: Pounds
- Waste Quantity, in Tons: 0.75
- Acute Waste Quantity, in Tons: 0
- Non-Acute Waste Quantity, in Tons: 0.75
- Waste Quantity, in Kilograms: 680.2725
- Acute Waste Quantity, in Kilograms: 0
- Non-Acute Waste Quantity, in Kilorgrams: 680.2725
- Management Method Code: H120
- Management Method Description: COMB. OF CHEMICAL, BIOLOGICAL, AND/OR PHYSICAL TRT
- Waste Residue Indicator: N
- Quantity Discrepancy Indicator: N
- Waste Type Discrepancy Indicator: N
- Waste Density: Not reported
- Waste Density Unit of Measure Code: Not reported
- Waste Density Unit of Measure Description: Not reported
- Form Code: Not reported
- Form Code Description: Not reported
- Source Code: Not reported
- Source Code Description: Not reported
- Waste Minimization Code: Not reported
- Waste Minimization Code Description: Not reported
- Consent Number: Not reported
- EPA Waste Indicator: Y

A11
NNW
< 1/8
0.046 mi.
242 ft.

FIRE STATION #1
900 SOUTH STATE ST
SYRACUSE, NY 13202

Site 8 of 8 in cluster A

NY AST **A100472594**
N/A

Relative:
Lower

Actual:
396 ft.

AST:

Name:	FIRE STATION #1
Address:	900 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Region:	STATE
DEC Region:	7
Site Status:	Active
Facility Id:	7-181935
Program Type:	PBS
UTM X:	406500.41583
UTM Y:	4766163.01145
Expiration Date:	06/30/2027
Site Type:	Municipality (Incl. Waste Water Treatment Plants, Utilities, Swimming Pools, etc.)

Affiliation Records:

Site Id:	45039
Affiliation Type:	Emergency Contact
Company Name:	CITY OF SYRACUSE FIRE DEPT
Contact Type:	Not reported
Contact Name:	CHIEF OF FIRE
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(315) 473-3230
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2013-05-13

Site Id:	45039
Affiliation Type:	Facility Operator
Company Name:	FIRE STATION #1
Contact Type:	Not reported
Contact Name:	JEFF GROSSO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 473-5495
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2019-03-06

Site Id:	45039
Affiliation Type:	Facility Owner
Company Name:	CITY OF SYRACUSE
Contact Type:	DEPUTYCHIEF - SYRACUSE FIRE DEPT
Contact Name:	ZACH SMITH

FIRE STATION #1 (Continued) **A100472594**

Address1:	CITY HALL - 233 EAST WASHINGTON ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 448-8200
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2022-04-26

Site Id:	45039
Affiliation Type:	Mail Contact
Company Name:	CITY OF SYRACUSE FIRE DEPT
Contact Type:	Not reported
Contact Name:	ZACH SMITH
Address1:	FIRE MAINTENANCE
Address2:	312 STATE FAIR BLVD
City:	SYRACUSE
State:	NY
Zip Code:	13204
Country Code:	001
Phone:	(315) 448-4777
EMail:	ZSMITH@SYRGOV.NET
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2022-04-26

Tank Info:

Tank Number:	102
Tank Id:	280124

Equipment Records:

A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
K00 - Spill Prevention - None
G12 - Tank Secondary Containment - Double-Walled (AG only)
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
J06 - Dispenser - Tank Mounted Dispenser
I04 - Overfill - Product Level Gauge (A/G)
D00 - Pipe Type - No Piping
L00 - Piping Leak Detection - None
E00 - Piping Secondary Containment - None

Tank Location:	Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	02/22/2019
Capacity Gallons:	1000
Tightness Test Method:	-
Date Test:	Not reported
Next Test Date:	Not reported

FIRE STATION #1 (Continued) **A100472594**

Date Tank Closed: Not reported
Register: True
Modified By: MJGRIFFI
Last Modified: 05/09/2022
Material Name: gasoline

B12 **S STATE STREET** **NY LTANKS** **S100494186**
SSW **S STATE ST/NEW STREET** **N/A**
< 1/8 **SYRACUSE, NY**
0.046 mi.
244 ft. **Site 3 of 3 in cluster B**

Relative: **Higher**

Actual: **398 ft.**

LTANKS:

Name:	S STATE STREET
Address:	S STATE ST/NEW STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9208359 / 1993-01-26
Facility ID:	9208359
Site ID:	229077
Spill Date:	1992-10-19
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C4
Cleanup Ceased:	1993-01-26
SWIS:	3415
Investigator:	MENASH
Referred To:	Not reported
Reported to Dept:	1992-10-20
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1992-10-20
Spill Record Last Update:	1993-01-27
Spiller Name:	Not reported
Spiller Company:	SYRACUSE HOUSING AUTH
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	188876
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MN
Remarks:	UNCOVERED 550 GAL TANK WHILE EXCAVATING FOR SEWER LINE. CONTAMINATED SOIL FOUND FROM LEAKING TANK. SOIL TO BE STAGED AND DISPOSED OF BY SYR HOUSING AUTH

All Materials:

Site ID:	229077
Operable Unit ID:	971954
Operable Unit:	01

S STATE STREET (Continued) **S100494186**

Material ID:	408947
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

C13 **SYRACUSE HOUSING AUTH - PIONEER HOMES** **RCRA-SQG 1010566800**
ESE **116-118 RADISSON COURT** **NY MANIFEST NYR000154476**
< 1/8 **SYRACUSE, NY 13202**
0.049 mi.
258 ft. **Site 1 of 2 in cluster C**

Relative: **Higher**

Actual: **401 ft.**

RCRA Listings:

Date Form Received by Agency:	20080205
Handler Name:	Syracuse Housing Auth - Pioneer Homes
Handler Address:	Radisson Court
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYR000154476
Contact Name:	WILLIAM W GEHRKE
Contact Address:	BURT ST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-470-4315
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Other
Federal Waste Generator Description:	Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	RADISSON COURT
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566800**

Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D002
Waste Description:	Corrosive Waste

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name: SYRACUSE HOUSING AUTH	
Legal Status:	Other
Date Became Current:	19400101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: SYRACUSE HOUSING AUTH	
Legal Status:	Other
Date Became Current:	19400101
Date Ended Current:	Not reported
Owner/Operator Address:	516 BURT ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566800**

Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20080205
Handler Name: SYRACUSE HOUSING AUTH - PIONEER HOMES
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080206
Handler Name: SYRACUSE HOUSING AUTH - PIONEER HOMES
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 92511
NAICS Description: ADMINISTRATION OF HOUSING PROGRAMS

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

NY MANIFEST:
EPA ID: NYR000154476
Country: USA
Name: SYRACUSE HOUSING AUTH - PIONEER HOMES
Address: 116-118 RADISSON COURT
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported
Location Address 1: 116-118 RADISSON COURT
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566800**

Code: BP

Mailing:
Mailing Name: SYRACUSE HOUSING AUTH - PIONEER HOMES
Mailing Contact: WILLIAM GEKRKE
Mailing Address 1: 516 BURT ST
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154704315

Manifest Data:
Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NYR000115733
Year: 2018
Trans2 State ID: NYD980761191
Generator Ship Date: 03/12/2008
Trans1 Recv Date: 03/12/2008
Trans2 Recv Date: 03/21/2008
TSD Site Recv Date: 03/25/2008
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000154476
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: PAD067098822
TSDF ID 2: Not reported
Manifest Tracking Number: 000885784FLE
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H141
Waste Code a: CORROSIVE WASTE
Waste Code b: Not reported
Waste Code c: Not reported
Waste Code e: Not reported
Waste Code f: Not reported
Waste Code g: Not reported
Waste Code 1: Not reported
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 30
Units: Gallons (liquids only)
Number of Containers: 1
Container Type: Metal drums, barrels, kegs

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566800**

Handling Method: Landfill
Specific Gravity: 1

C14 **PARKING LOT- 111 RADISON COURT** **NY Spills** **S126996788**
ESE **111 RADISON CT** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.056 mi.
296 ft. **Site 2 of 2 in cluster C**

Relative: **Higher**
Actual: **402 ft.**

SPILLS:

Name:	PARKING LOT- 111 RADISON COURT
Address:	111 RADISON CT
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	2005041 / 2022-05-13
Facility ID:	2005041
Facility Type:	ER
DER Facility ID:	559030
Site ID:	610813
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	B1
SWIS:	3415
Spill Date:	2020-09-01
Investigator:	CFNORRIS
Referred To:	Not reported
Reported to Dept:	2020-09-01
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Passenger Vehicle
Spill Notifier:	Fire Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	2020-09-01
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2020-09-01
Spill Record Last Update:	2022-06-06
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	ASHLEY
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	RP HIT DEBRIS ON HIGHWAY. HER GAS TANK AND TIRE WERE PUNCTURED. TANK PLUG FAILED, AND GAS LEAKED ONTO PARKING LOT OUTSIDE RP'S SISTER'S APARTMENT ON RADISSON COURT. SYRACUSE FD NOTIFIED AFTER PROGRESSIVE RECOMMENDATION. FD PUT DOWN SPEEDY-DRI AND NOTIFIED HOTLINE. I TOOK 15 MINUTES TO REACH SPILL SITE. FD WAS ALREADY OFF-SITE. PROGRESSIVE HIRED TOW COMPANY, BUT THEY WERE NOT PREPARED TO REMOVE SPEEDY-DRI OR CONTINUE LOCATION DECOMMTAMINATION. I HIRED NRC TO CLEAR PARKING LOT OF GASOLINE SPILL. A MAN CAME OVER TO TALK TO FEMALE DRIVER. I DO NOT KNOW IF THAT WAS THE REGISTERED

PARKING LOT- 111 RADISON COURT (Continued) **S126996788**

VEHICLE OWNER. VEHICLE PLATE IS JRP-7723. FEMALE DRIVER NAME IS UNKNOWN. 11/2021 I CALLED SYRACUSE
FIRE. THEY WERE UNABLE TO SUPPLY REPORTS WITHOUT A FEE. 06/06/2022 I DECIDED TO CONTACT THE SHERIFF
RECORDS, IN CASE THEY HAD A CONTACT WITH CITY FIRE. THE SHERIFF RECORDS CONTACT STATED THAT THE
SHERIFF HAS ACCESS TO CITY FIRE REPORTS, BUT, THIS SPILL HAS NO REPORT. IT WAS LISTED AS A HAZARD
CALL (E10), AND WITHDRAWN. THE DR NUMBER IS DR 20-41725.

Remarks: c/u pending

All Materials:

Site ID:	610813
Operable Unit ID:	1357959
Operable Unit:	01
Material ID:	2369387
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	PARKING LOT- 111 RADISON COURT
Address:	111 RADISON CT
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	2005041 / 2022-05-13
Facility ID:	2005041
Facility Type:	ER
DER Facility ID:	559030
Site ID:	610813
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	B1
SWIS:	3415
Spill Date:	2020-09-01
Investigator:	CFNORRIS
Referred To:	Not reported
Reported to Dept:	2020-09-01
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Passenger Vehicle
Spill Notifier:	Fire Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	2020-09-01
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2020-09-01
Spill Record Last Update:	2022-06-06
Spiller Name:	tyrone j english jr
Spiller Company:	registered car owner
Spiller Address:	614 oakwood ave

PARKING LOT- 111 RADISON COURT (Continued) **S126996788**

Spiller Company: 999
Contact Name: ASHLEY
Latitude: Not reported
Longitude: Not reported
DEC Memo: RP HIT DEBRIS ON HIGHWAY. HER GAS TANK AND TIRE WERE PUNCTURED. TANK PLUG FAILED, AND GAS LEAKED ONTO PARKING LOT OUTSIDE RP'S SISTER'S APARTMENT ON RADISSON COURT. SYRACUSE FD NOTIFIED AFTER PROGRESSIVE RECOMMENDATION. FD PUT DOWN SPEEDY-DRI AND NOTIFIED HOTLINE. I TOOK 15 MINUTES TO REACH SPILL SITE. FD WAS ALREADY OFF-SITE. PROGRESSIVE HIRED TOW COMPANY, BUT THEY WERE NOT PREPARED TO REMOVE SPEEDY-DRI OR CONTINUE LOCATION DECOMMTAMINATION. I HIRED NRC TO CLEAR PARKING LOT OF GASOLINE SPILL. A MAN CAME OVER TO TALK TO FEMALE DRIVER. I DO NOT KNOW IF THAT WAS THE REGISTERED VEHICLE OWNER. VEHICLE PLATE IS JRP-7723. FEMALE DRIVER NAME IS UNKNOWN. 11/2021 I CALLED SYRACUSE FIRE. THEY WERE UNABLE TO SUPPLY REPORTS WITHOUT A FEE. 06/06/2022 I DECIDED TO CONTACT THE SHERIFF RECORDS, IN CASE THEY HAD A CONTACT WITH CITY FIRE. THE SHERIFF RECORDS CONTACT STATED THAT THE SHERIFF HAS ACCESS TO CITY FIRE REPORTS, BUT, THIS SPILL HAS NO REPORT. IT WAS LISTED AS A HAZARD CALL (E10), AND WITHDRAWN. THE DR NUMBER IS DR 20-41725.
Remarks: c/u pending

All Materials:
Site ID: 610813
Operable Unit ID: 1357959
Operable Unit: 01
Material ID: 2369387
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 10.00
Units: G
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: Not reported

D15 **MANHOLE 7-1** **NY Spills** **S131920114**
NNE **907 SOUTH TOWNSEND ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.057 mi.
303 ft. **Site 1 of 2 in cluster D**

Relative: SPILLS:
Lower
Actual: Name: MANHOLE 7-1
397 ft. Address: 907 SOUTH TOWNSEND ST
City,State,Zip: SYRACUSE, NY 13202
Spill Number/Closed Date: 2400382 / 2024-04-15
Facility ID: 2400382
Facility Type: ER
DER Facility ID: 611807
Site ID: 666699

MANHOLE 7-1 (Continued) **S131920114**

DEC Region:	7
Spill Cause:	Unknown
Spill Class:	E6
SWIS:	3415
Spill Date:	2024-04-11
Investigator:	AYRUSSO
Referred To:	Not reported
Reported to Dept:	2024-04-11
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2024-04-11
Spill Record Last Update:	2024-06-07
Spiller Name:	HORATIO RIVERA
Spiller Company:	NATL GRID
Spiller Address:	907 SOUTH TOWNSEND ST
Spiller Company:	999
Contact Name:	HORATIO RIVERA
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	2024.04.11 Unknown sheen on manhole. Clean Harbours to respond for cleanup. Environmental contractor called out to remove water and soil in manhole. No spill. NFA
Remarks:	water and muck 50 square feet inside manhole. at intersection of Adams and Townsend

All Materials:

Site ID:	666699
Operable Unit ID:	1413532
Operable Unit:	01
Material ID:	2431319
Material Code:	0064A
Material Name:	unknown material
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

D16 **DABLON COURT** **NY Spills** **S102167454**
NE **DABLON COURT (PIONEER HOM)** **N/A**
< 1/8 **SYRACUSE, NY**
0.062 mi.
328 ft. **Site 2 of 2 in cluster D**

Relative:
Higher

Actual:
398 ft.

SPILLS:

Name:	DABLON COURT
Address:	DABLON COURT (PIONEER HOM)
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9401370 / 1994-04-28
Facility ID:	9401370
Facility Type:	ER
DER Facility ID:	119304
Site ID:	139643
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	3415
Spill Date:	1994-04-27
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1994-04-28
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Responsible Party
Cleanup Ceased:	1994-04-28
Cleanup Meets Std:	False
Last Inspection:	1994-04-28
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1994-04-29
Spill Record Last Update:	1995-01-11
Spiller Name:	Not reported
Spiller Company:	SYRACUSE HOUSING AUTHORIT
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM 04/28/94: MET W/ PETE OF HOUSING AUTHORITY: REMOVE SOILS AND FUTURE. 09/28/95: This is additional information about material spilled from the translation of the old spill file: CATCH BASIN SLUDGE.
Remarks:	ACCUMULATION OF USED OIL,ETC. ON GROUND AN IN STORM DRAIN.

All Materials:

Site ID:	139643
Operable Unit ID:	995161
Operable Unit:	01
Material ID:	385127
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00

DABLON COURT (Continued) **S102167454**

Units: L
Recovered: .00
Resource Affected: Soil
Oxygenate: Not reported

E17 **CITY OWNED APARTMENT COMPLEX** **NY Spills** **S131919859**
South **301-311 EAST TAYLOR ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.065 mi.
345 ft. **Site 1 of 9 in cluster E**

Relative:
Higher

Actual:
399 ft.

SPILLS:

Name:	CITY OWNED APARTMENT COMPLEX
Address:	301-311 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2400040 / Not Reported
Facility ID:	2400040
Facility Type:	ER
DER Facility ID:	609512
Site ID:	664372
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	Not reported
SWIS:	3415
Spill Date:	2024-04-02
Investigator:	CBKERLIN
Referred To:	Not reported
Reported to Dept:	2024-04-02
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	1
Date Entered In Computer:	2024-04-02
Spill Record Last Update:	2024-04-02
Spiller Name:	MATT WALKER
Spiller Company:	UNK
Spiller Address:	301-311 EAST TAYLOR ST
Spiller Company:	999
Contact Name:	MATT WALKER
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	4/2/24: Phase II test results came back with BTEX hits in soil and water, site used to be a gas station. Part of I-81 redevelopment project. (CBK)
Remarks:	phase 2 results from 3/5/24 soil and ground water affected. clean up pending. location is an old gas stations from the 1950s

All Materials:

Site ID:	664372
Operable Unit ID:	1411191
Operable Unit:	01

CITY OWNED APARTMENT COMPLEX (Continued) **S131919859**

Material ID:	2428949
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Soil, Groundwater
Oxygenate:	Not reported

F18 **ONONDAGA CO. HEALTH DEPT.** **NY LTANKS** **S100153271**
NNW **STATE STREET SITE** **N/A**
< 1/8 **SYRACUSE, NY**
0.072 mi.
382 ft. **Site 1 of 9 in cluster F**

Relative: **Lower**

Actual: **396 ft.**

LTANKS:

Name:	ONONDAGA CO. HEALTH DEPT.
Address:	STATE STREET SITE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9108484 / 1992-04-15
Facility ID:	9108484
Site ID:	188210
Spill Date:	1991-08-23
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	1992-04-13
SWIS:	3415
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1991-08-23
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1991-12-11
Spill Record Last Update:	1995-06-02
Spiller Name:	Not reported
Spiller Company:	ONONDAGA CO HEALTH DEPT
Spiller Address:	STATE STREET
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	157250
Latitude:	43.0302280
Longitude:	-75.6497120
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 04/15/92: 2 TANKS DISCOVERED DURING EXCAVATION OF NEW JAIL. 3 ROLLOFFS OF CONTAMINATED SOIL EXACAVTED FOR DISPOSAL. TANKS WERE

ONONDAGA CO. HEALTH DEPT. (Continued) **S100153271**

CLEANED BY EPS-CHRIS MEYERS COORDINATOR FOR EPS.
Remarks: TANK CLOSURE DATE ANTICIPATED APRIL 1992.

All Materials:
Site ID: 188210
Operable Unit ID: 962533
Operable Unit: 01
Material ID: 559140
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: 25.00
Units: Not reported
Recovered: 15.00
Resource Affected: Groundwater
Oxygenate: Not reported

F19 **NY1-1 PIONEER HOMES** **NY AST** **U003078218**
NNW **ADAMS/RENWICK/TAYLOR/STATE** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.078 mi.
410 ft. **Site 2 of 9 in cluster F**

Relative: **Lower**
Actual: **396 ft.**

AST:
Name: NY1-1 PIONEER HOMES
Address: ADAMS/RENWICK/TAYLOR/STATE
City,State,Zip: SYRACUSE, NY 13202
Region: STATE
DEC Region: 7
Site Status: Unregulated/Closed
Facility Id: 7-498947
Program Type: PBS
UTM X: 406600.05465
UTM Y: 4766007.99600
Expiration Date: N/A
Site Type: Apartment Building/Office Building

Affiliation Records:
Site Id: 46336
Affiliation Type: Mail Contact
Company Name: SYRACUSE HOUSING AUTHORITY
Contact Type: Not reported
Contact Name: ANDREW BARSUCH
Address1: 516 BURT ST
Address2: Not reported
City: SYRACUSE
State: NY
Zip Code: 13202
Country Code: 001
Phone: (315) 475-6181
EMail: ABARSUCH@SYRHOUSING.ORG
Fax Number: Not reported
Modified By: KCKEMP
Date Last Modified: 2011-01-14

Site Id: 46336
Affiliation Type: Facility Operator

NY1-1 PIONEER HOMES (Continued) **U003078218**

Company Name:	NY1-1 PIONEER HOMES
Contact Type:	Not reported
Contact Name:	GREG PALMER
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 706-3727
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2011-01-14

Site Id:	46336
Affiliation Type:	Emergency Contact
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	ANDREW BARSUCH
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(315) 439-4788
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2011-01-14

Site Id:	46336
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	EXECUTIVE DIRECTOR
Contact Name:	WILLIAM SIMMONS
Address1:	516 BURT ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 475-6181
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2011-01-14

Tank Info:

Tank Number:	001
Tank Id:	133567
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

NY1-1 PIONEER HOMES (Continued) **U003078218**

Equipment Records:

F99 - Pipe External Protection - Other
C01 - Pipe Location - Aboveground
I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
B00 - Tank External Protection - None
J02 - Dispenser - Suction Dispenser

Tank Location:	Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	12/01/1984
Capacity Gallons:	2500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	11/22/2010
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	#2 fuel oil (on-site consumption)
Tank Number:	002
Tank Id:	133568
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Equipment Records:

F99 - Pipe External Protection - Other
C01 - Pipe Location - Aboveground
I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
L09 - Piping Leak Detection - Exempt Suction Piping
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction Dispenser

Tank Location:	Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	12/01/1984
Capacity Gallons:	2500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	11/22/2010
Register:	True

NY1-1 PIONEER HOMES (Continued) **U003078218**

Modified By: MJGRIFFI
Last Modified: 05/09/2022
Material Name: #2 fuel oil (on-site consumption)

F20 **EAST COLVIN AND** **NY Spills** **S100667614**
NNW **STATE STREET** **N/A**
< 1/8 **SYRACUSE, NY**
0.079 mi.
419 ft. **Site 3 of 9 in cluster F**

Relative: **Lower**
Actual: **396 ft.**

SPILLS:
Name: EAST COLVIN AND
Address: STATE STREET
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 9608949 / 1996-11-18
Facility ID: 9608949
Facility Type: ER
DER Facility ID: 210740
Site ID: 231429
DEC Region: 7
Spill Cause: Equipment Failure
Spill Class: C3
SWIS: 3415
Spill Date: 1996-10-18
Investigator: HDWARNER
Referred To: Not reported
Reported to Dept: 1996-10-18
CID: 270
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1996-10-18
Spill Record Last Update: 1996-11-16
Spiller Name: PAT STOCK
Spiller Company: SYRACUSE UNIVERSITY
Spiller Address: 029 LYMAN HALL
Spiller Company: 001
Contact Name: PAT
Latitude: Not reported
Longitude: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was HW
Remarks: line broke on vehicle

All Materials:
Site ID: 231429
Operable Unit ID: 1037056
Operable Unit: 01
Material ID: 344681
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum

EAST COLVIN AND (Continued) **S100667614**

Quantity:	30.00
Units:	G
Recovered:	10.00
Resource Affected:	Soil
Oxygenate:	Not reported

F21 **ADAMS & STATE ST. GARAGE** **UST FINDER RELEASE** **1029062545**
NNW **ADAMS & STATE STREET** **N/A**
< 1/8 **SYRACUSE, NY 0**
0.081 mi.
427 ft. **Site 4 of 9 in cluster F**

Relative:
Lower

Actual:
396 ft.

UST FINDER RELEASE:

Object ID:	249474
Facility ID:	NY174767
Lust ID:	NY9108385
Name:	ADAMS & STATE ST. GARAGE
Address:	ADAMS & STATE STREET
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1991/11/06 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1993
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1475399999999
Y Coord:	43.04274
Latitude:	43.04274
Longitude:	-76.14754

F22 **PARKING GARAGE** **NY Spills** **S103567316**
NNW **STATE ST & ADAMS ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.081 mi.
427 ft. **Site 5 of 9 in cluster F**

Relative:
Lower

Actual:
396 ft.

SPILLS:

Name:	PARKING GARAGE
Address:	STATE ST & ADAMS ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9111803 / 1992-03-12
Facility ID:	9111803
Facility Type:	ER
DER Facility ID:	239147
Site ID:	295517
DEC Region:	7
Spill Cause:	Other
Spill Class:	Not reported
SWIS:	3415
Spill Date:	1992-02-17
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1992-02-17
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	1992-02-17
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1992-02-18
Spill Record Last Update:	1995-03-09
Spiller Name:	Not reported
Spiller Company:	UNK
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	Not reported
Latitude:	43.0427389
Longitude:	-76.1475419
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 03/12/92: FREE PRODUCT(GASOLINE) DISCOVERED IN OLD DRYWELL. DRYWELL EXCAVATED AFTER BEING PUMPED OUT. RESIDUAL AMOUNT OF CONTAMINATED SOIL REMAINS; TO BE UNDER PARKING GARAGE FLOOR.
Remarks:	ABANDONED UG TANK FOUND WHILE EXCAVATING.

All Materials:

Site ID:	295517
Operable Unit ID:	965489
Operable Unit:	01
Material ID:	416817
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	200.00
Units:	G

PARKING GARAGE (Continued) **S103567316**

Recovered: 200.00
Resource Affected: Soil
Oxygenate: Not reported

F23 **ADAMS & STATE ST. GARAGE** **NY LTANKS** **S105054364**
NNW **ADAMS & STATE STREET** **N/A**
< 1/8 **SYRACUSE, NY**
0.081 mi.
427 ft. **Site 6 of 9 in cluster F**

Relative: **Lower**
Actual: **396 ft.**

LTANKS:

Name:	ADAMS & STATE ST. GARAGE
Address:	ADAMS & STATE STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9108385 / 1991-11-07
Facility ID:	9108385
Site ID:	210798
Spill Date:	1991-11-06
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	1991-11-07
SWIS:	3415
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1991-11-06
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1991-11-06
Spill Record Last Update:	1997-03-10
Spiller Name:	Not reported
Spiller Company:	ONONDAGA COUNTY
Spiller Address:	Not reported
Spiller County:	999
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	174767
Latitude:	43.0427389
Longitude:	-76.1475419
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 11/07/91: EPS HIRED BY ONONDAGA COUNTY TO CLEAN AND REMOVE TANKS. 8 BARRELS OFWATER PUMPED FROM THE TWO TANKS FOR DISPOSAL. ALSO ONE BARREL OF SOIL. NO RESIDUAL CONTAMINATION REMAINING IN SOIL SURROUNDING TANKS.
Remarks:	ONE TANK WAS DISCOVERED ON 11/05/91 AT 3:00. ON MORNING OF 11/06/91 THERE WAS ANOTHER TANK LOCATED WHICH WAS DAMAGED AND PRODUCT SPILLED.

All Materials:

Site ID:	210798

ADAMS & STATE ST. GARAGE (Continued) **S105054364**

Operable Unit ID:	958676
Operable Unit:	01
Material ID:	420535
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

G24 **STEAM PLANT** **NY LTANKS** **S104278476**
SE **MCBRIDE ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.095 mi.
501 ft. **Site 1 of 15 in cluster G**

Relative: LTANKS:
Higher

Name:	STEAM PLANT
Address:	MCBRIDE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9908800 / 1999-11-23
Facility ID:	9908800
Site ID:	259520
Spill Date:	1999-10-20
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1999-10-20
CID:	257
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1999-10-20
Spill Record Last Update:	1999-11-23
Spiller Name:	JIM MCCUMBER
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	285 AINSLEY DR
Spiller County:	001
Spiller Contact:	PAT STOCK
Spiller Phone:	(315) 443-4132
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	212253
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM

Actual:
407 ft.

STEAM PLANT (Continued) **S104278476**

Remarks: old contamination from a old tank that was closed 10yrs ago

All Materials:

Site ID:	259520
Operable Unit ID:	1087484
Operable Unit:	01
Material ID:	297899
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

E25 **THE SALVATION ARMY** **NY UST** **U000415424**
South **1105 S. STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.096 mi.
506 ft. **Site 2 of 9 in cluster E**

Relative:
Higher

Actual:
399 ft.

UST:

Name:	THE SALVATION ARMY
Address:	1105 S. STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-128058 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	406539.18601
UTM Y:	4765799.29374
Site Type:	Other

Affiliation Records:

Site Id:	44653
Affiliation Type:	Facility Owner
Company Name:	THE SALVATION ARMY INC.
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	440 W. NYACK RD.
Address2:	Not reported
City:	WEST NYACK
State:	NY
Zip Code:	10994
Country Code:	001
Phone:	(212) 337-4779
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	44653
Affiliation Type:	Mail Contact
Company Name:	THE SALVATION ARMY INC.
Contact Type:	Not reported

THE SALVATION ARMY (Continued) **U000415424**

Contact Name:	Not reported
Address1:	440 W. NYACK RD.
Address2:	P.O. BOX C-635
City:	W. NYACK
State:	NY
Zip Code:	10994-0635
Country Code:	001
Phone:	(914) 620-4779
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	44653
Affiliation Type:	Emergency Contact
Company Name:	THE SALVATION ARMY INC.
Contact Type:	Not reported
Contact Name:	S. TIMOTHY LANTS, CAPTAIN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 475-9983
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	44653
Affiliation Type:	Facility Operator
Company Name:	THE SALVATION ARMY
Contact Type:	Not reported
Contact Name:	THE SALVATION ARMY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 583-3500
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Tank Info:

Tank Number:	001
Tank ID:	128169
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	5000
Install Date:	12/01/1986
Date Tank Closed:	01/01/1998
Registered:	True

THE SALVATION ARMY (Continued) **U000415424**

Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

H00 - Tank Leak Detection - None
B02 - Tank External Protection - Original Sacrificial Anode
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None

E26 **FORMER SALVATION ARMY** **UST FINDER RELEASE** **1029076786**
South **1105 SOUTH STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 0**
0.096 mi.
506 ft. **Site 3 of 9 in cluster E**

Relative:
Higher

Actual:
399 ft.

UST FINDER RELEASE:

Object ID:	249485
Facility ID:	NY59475
Lust ID:	NY404882
Name:	FORMER SALVATION ARMY
Address:	1105 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	2004/08/04 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	2276
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported

FORMER SALVATION ARMY (Continued) **1029076786**

NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1473599999999
Y Coord:	43.0391300000001
Latitude:	43.03913
Longitude:	-76.14736

E27 **THE SALVATION ARMY** **UST FINDER** **1028588420**
South **1105 S. STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.096 mi.
506 ft. **Site 4 of 9 in cluster E**

Relative:
Higher

Actual:
399 ft.

UST FINDER:

Object ID:	318213
Facility ID:	NY44653
Name:	THE SALVATION ARMY
Address:	1105 S. STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	1
TOS USTs:	0
Population 1500ft:	2276
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Closed UST(s)
Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.147364
Y Coord:	43.039134
Latitude:	43.039134
Longitude:	-76.147364

UST FINDER:

Object ID:	1276629
Facility ID:	NY44653
Tank ID:	NY70277
Tank Status:	Closed
Installation Date:	1986/12/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	5000
Substances:	Not reported

THE SALVATION ARMY (Continued) **1028588420**

Tank Wall Type: Not reported

E28 **SPILL NUMBER 8601904** **NY Spills** **S104643869**
South **1105 SOUTH STATE ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.096 mi.
506 ft. **Site 5 of 9 in cluster E**

Relative:
Higher

Actual:
399 ft.

SPILLS:

Name:	SPILL NUMBER 8601904
Address:	1105 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8601904 / 1987-08-11
Facility ID:	8601904
Facility Type:	ER
DER Facility ID:	59475
Site ID:	142087
DEC Region:	7
Spill Cause:	Human Error
Spill Class:	Not reported
SWIS:	3415
Spill Date:	1986-06-19
Investigator:	UNASSIGNED
Referred To:	Not reported
Reported to Dept:	1986-06-19
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Fire Department
Cleanup Ceased:	1987-08-11
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	Not reported
Latitude:	43.0391313
Longitude:	-76.1473662
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was / / : DEC INVEST. & TOLD F.D. TO USE SORBENT & SAND THE REST.
Remarks:	ON PAVEMENT-55 GAL. DRUM FELL OFF TRUCK-F.D. ON SCENE

All Materials:

Site ID:	142087
Operable Unit ID:	898181
Operable Unit:	01
Material ID:	478370
Material Code:	0028A
Material Name:	ethylene glycol
Case No.:	00107211

SPILL NUMBER 8601904 (Continued) **S104643869**

Material FA:	Hazardous Material
Quantity:	30.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

E29 **SALVATION ARMY** **NY LTANKS** **S102165578**
South **1105 SOUTH STATE ST** **NY Spills** **N/A**
< 1/8 **SYRACUSE, NY**
0.096 mi.
506 ft. **Site 6 of 9 in cluster E**

Relative: **Higher**

Actual: **399 ft.**

LTANKS:

Name:	FORMER SALVATION ARMY
Address:	1105 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0404882 / 2005-03-04
Facility ID:	0404882
Site ID:	61010
Spill Date:	2004-08-04
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	BFMATTHE
Referred To:	Not reported
Reported to Dept:	2004-08-04
CID:	403
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	2004-08-04
Spill Record Last Update:	2005-03-04
Spiller Name:	DAVID FICKINGER
Spiller Company:	SALVATION ARMY
Spiller Address:	1105 SOUTH STATE ST
Spiller County:	999
Spiller Contact:	DAVID FICKINGER
Spiller Phone:	(315) 475-6181
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	59475
Latitude:	43.0391340
Longitude:	-76.1473630
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BM
Remarks:	550 gallon tank.excavation.removing contaminated soil

All Materials:

Site ID:	61010
Operable Unit ID:	888280
Operable Unit:	01

SALVATION ARMY (Continued) **S102165578**

Material ID:	488856
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

SPILLS:

Name:	SALVATION ARMY
Address:	1105 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9711143 / 2002-08-06
Facility ID:	9711143
Facility Type:	ER
DER Facility ID:	59475
Site ID:	61011
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	1998-01-05
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1998-01-05
CID:	252
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	True
Remediation Phase:	0
Date Entered In Computer:	1998-01-05
Spill Record Last Update:	2002-08-06
Spiller Name:	CAPT MUHS
Spiller Company:	SALVATION ARMY
Spiller Address:	1105 SOUTH STATE ST
Spiller Company:	001
Contact Name:	CAPT MUHS
Latitude:	43.0391313
Longitude:	-76.1473662
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM LIMITED INFORMATION, CONTAMINATION MAY EXIST
Remarks:	SOIL CONTAMINATION DISCOVERED UNDER PUMP ISLAND DISPENSER. WILL BE STOCKPILED FOR REMOVAL.

E30 **SALVATION ARMY** **UST FINDER RELEASE** **1029076787**
South **1105 SOUTH STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 0**
0.096 mi.
506 ft. **Site 7 of 9 in cluster E**

Relative: **Higher**
Actual: **399 ft.**

UST FINDER RELEASE:

Object ID:	249484
Facility ID:	NY59475
Lust ID:	NY9711143
Name:	SALVATION ARMY
Address:	1105 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1998/01/05 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	2273
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.14737
Y Coord:	43.0391300000001
Latitude:	43.03913
Longitude:	-76.1473699999999

E31 **EAST ADAMS REDEVELOPMENT - PHASE II AREA** **NY BROWNFIELDS** **S131764066**
South **1105-1117 SOUTH STATE STREET** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.096 mi.
506 ft. **Site 8 of 9 in cluster E**

Relative: **Higher**
Actual: **399 ft.**

BROWNFIELDS:

Name:	EAST ADAMS REDEVELOPMENT - PHASE II AREA
Address:	1105-1117 SOUTH STATE STREET
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	659420
Acres:	2.540
HW Code:	C734163
SWIS:	3415
Town:	Syracuse (c)

EAST ADAMS REDEVELOPMENT - PHASE II AREA (Continued) **S131764066**

Record Added Date: 12/06/2023
Record Updated Date: 03/13/2024
Update By: GWPRISCO
Site Description: "Location: The site is located at 1105 1117 South State Street within an urban, mixed-use area in the City of Syracuse, New York. The site is about 2.5 acres and is comprised of Onondaga County Tax Parcel ID 094.-08.-04.0. The site is bound by a railroad at 300 East Taylor Street followed by East Taylor Street and residential buildings to the north, Oakwood Avenue and commercial buildings at 116 Oakwood Avenue and 140 Oakwood Avenue followed by a railroad at 1212 South McBride Street and vacant commercial land at 409 Burt Street to the east, Burt Street followed by residential buildings at 313 East Raynor Avenue to the south, and South State Street followed by a railroad at 1100 South State Street, commercial building at 1106 South State Street, and church at 1110 South State Street to the west. The site is currently vacant with two small structures present in the northwestern corner of the site. The site was most recently used as a commercial parking lot, with a tenant leasing the space from the Syracuse Housing Authority. The structures were previously utilized as a waiting area for buses and an office/ticket counter for the commercial parking lot. The site is fenced, with gated access, and is predominantly covered with a packed gravel surface. The eastern part of the site has a separate gated access, is partially covered with vegetation, and is used by the Syracuse Housing Authority for storage of landscaping equipment. The area surrounding the site consists of residential, commercial, institutional, and industrial properties. Site Features: According to the March 2023 Phase I Environmental Site Assessment (ESA) and the June 2023 Phase II ESA prepared by EA engineering, P.C. and its affiliate EA Science and Technology (EA), the elevation of the site is about elevation (el) 397 feet. The topography of the site is generally flat with the surrounding area gently sloping towards the west-southwest. Current Zoning and Land Use: According to the Rezone Syracuse ordinance and City of Syracuse Zoning Map, the site is located within an MX-2: Neighborhood Center District. The MX-2: Neighborhood Center zoning district is generally characterized as pedestrian-friendly, transit-supportive mix of medium to higher density residential uses and non-residential uses that offer goods and services to surrounding neighborhoods. The surrounding properties are zoned for MX-2: Neighborhood Center Districts, MX-3: Mixed-Use Transition, MX-4: Urban Core, R2: Low Density Residential, R5: High Density Residential, LI: Light Industrial and Employment, and OS: Open Space. Land use within a half-mile radius is urban and includes residential, commercial, institutional/public services, industrial, vacant land, and public parks. The nearest ecological receptor is the Onondaga Creek, located approximately 0.4 miles west of the site. At present, the site is vacant and is predominantly covered with a packed gravel surface. Two small structures are present in the northwestern corner of the site and the eastern part of the site is partially covered with vegetation. Past Use of the Site: Historical documents indicate that the site has been located in a residential, commercial, and industrial area since as early as 1892. Historical uses of the site included residential buildings (1892 to 1971), carriage manufacturing and painting (1892 to 1910), carpenter shops (1892), a stone works yard (1892), bridge manufacturing with two gasoline tanks (1910), clothing factory (1910), scrap metal yard (1951 to 1953), retail gasoline station with gasoline storage tanks (1951 to 1971), a chapel

EAST ADAMS REDEVELOPMENT - PHASE II AREA (Continued) **S131764066**

(1951 to 1990), upholstery shop (1951 to 1990), a paper baling facility (1951 to 1990), automobile repair (1959 to 1971), and a Salvation Army (1961 to 2003). The Syracuse Housing Authority purchased the site in 2003 and by 2005 the majority of the former buildings were demolished. By 2008, the site was developed into its present-day configuration and operated as a parking lot. Site Geology and Hydrogeology: According to the U.S. Department of Agriculture s (USDA) Natural Resources Conservation Service (NRCS) Soil Survey Geographic (SSURGO) data for the site, soils at the site are comprised primarily of urban land. Urban land is described as excavated, filled, and made land. According to the Phase II ESA conducted by EA and the February 2023 Geotechnical Data Report by CME Associates, soil at the site consists of historic fill comprised primarily of dark brown to gray silty clay with varying amounts of gravel, brick, asphalt, glass, and plastic to depths ranging from about 2 to 10 feet below grade surface (bgs). This layer is underlain by brown to gray silt, clay, and fine- to medium-grained sand with silt and clay to depths ranging from 18 to 39 feet bgs. A clay layer was also observed throughout the site at depths ranging from 18 to 96 feet bgs. Bedrock was not encountered during the subsurface investigations. Based on review of the Geologic Map of New York, Finger Lakes Sheet (Fisher, Isachsen, Rickard, dated March 1970) , the site is underlain by bedrock of the Syracuse Foundation, consisting of dolostone, shale, gypsum and salt. Based on measurements collected during the Phase II ESA conducted by EA, groundwater at the site flows to the southwest, following the local topography, towards Onondaga Creek. Groundwater was observed at depths ranging from about 5.5 to 8.9 feet bgs (corresponding to el. 384.39 to el. 385.75). "

Env Problem:	"Information submitted with the BCP application regarding the environmental condition at the site are currently under review and will be revised as additional information becomes available."
Health Problem:	"Information submitted with the BCP application regarding the conditions at the site are currently under review and will be revised as additional information becomes available."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2024-03-13 10:07:00
Record Upd:	2024-03-13 15:05:00
Updated By:	JMPELTON
Own Op:	4
Sub Type:	C01
Owner Name:	William J. Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03

EAST ADAMS REDEVELOPMENT - PHASE II AREA (Continued) **S131764066**

Owner Name:	Allyson Carpenter
Owner Company:	East Adams Phase II, L.P.
Owner Address:	100 North Broadway, Suite 100
Owner Addr2:	Not reported
Owner City,St,Zip:	St. Louis, MO 63102
Owner Country:	United States of America
Own Op:	1
Sub Type:	C01
Owner Name:	William J. Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Dan Smith
Owner Company:	Onondaga County Public Library Central Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America
HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	Not reported
Cross Ref Type Code:	Not reported
Cross Ref Type:	Not reported
Record Added Date:	Not reported
Record Updated:	Not reported
Updated By:	Not reported

F32 **CENTRAL TECH** **UST FINDER** **1028589651**
NNW **285 E. ADAMS ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.097 mi.
511 ft. **Site 7 of 9 in cluster F**

Relative: UST FINDER:
Lower

Actual: Object ID:	318285
395 ft. Facility ID:	NY45851
Name:	CENTRAL TECH
Address:	285 E. ADAMS ST
City,State,Zip:	SYRACUSE, NY 13202
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	1
TOS USTs:	0
Population 1500ft:	1389
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported

CENTRAL TECH (Continued) **1028589651**

Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Closed UST(s)
Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.149154
Y Coord:	43.0427750000001
Latitude:	43.042775
Longitude:	-76.149154

UST FINDER:

Object ID:	1281404
Facility ID:	NY45851
Tank ID:	NY72970
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	Not reported
Tank Capacity:	10000
Substances:	Not reported
Tank Wall Type:	Not reported

F33 **CENTRAL TECH** **NY UST** **U003313663**
NNW **285 E. ADAMS ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.097 mi.
511 ft. **Site 8 of 9 in cluster F**

Relative:
Lower

Actual:
395 ft.

UST:

Name:	CENTRAL TECH
Address:	285 E. ADAMS ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-430617 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	406398.91232
UTM Y:	4766205.62384
Site Type:	School

Affiliation Records:

Site Id:	45851
Affiliation Type:	Emergency Contact
Company Name:	SYRACUSE CITY SCHOOL DISTRICT
Contact Type:	Not reported
Contact Name:	CARL VERZILLO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 425-4248

CENTRAL TECH (Continued) **U003313663**

EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 45851
Affiliation Type: Facility Owner
Company Name: SYRACUSE CITY SCHOOL DISTRICT
Contact Type: Not reported
Contact Name: Not reported
Address1: 725 HARRISON ST.
Address2: Not reported
City: SYRACUSE
State: NY
Zip Code: 13210
Country Code: 001
Phone: (315) 425-4292
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 45851
Affiliation Type: Mail Contact
Company Name: SYRACUSE CITY SCHOOL DISTRICT
Contact Type: Not reported
Contact Name: ROBERT REIFEISS
Address1: 725 HARRISON ST.
Address2: Not reported
City: SYRACUSE
State: NY
Zip Code: 13210
Country Code: 001
Phone: (315) 425-4292
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 45851
Affiliation Type: Facility Operator
Company Name: CENTRAL TECH
Contact Type: Not reported
Contact Name: SYRACUSE CITY SCHOOL DISTRICT
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (315) 425-4300
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

CENTRAL TECH (Continued) **U003313663**

Tank Info:

Tank Number:	001
Tank ID:	132351
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	10000
Install Date:	Not reported
Date Tank Closed:	06/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	01
Date Test:	12/01/1989
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

H00 - Tank Leak Detection - None
J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None
I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

E34 **ROTH BROS METAL CO.** **SEMS-ARCHIVE** **1015754900**
South **1107 S. STATE STREET** **LEAD SMELTERS** **NYN000206645**
< 1/8 **SYRACUSE, NY 1320**
0.098 mi.
516 ft. **Site 9 of 9 in cluster E**

Relative:
Higher

Actual:
399 ft.

SEMS Archive:

Site ID:	0206645
EPA ID:	NYN000206645
Name:	ROTH BROS METAL CO.
Address:	1107 S. STATE STREET
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Cong District:	Not reported
FIPS Code:	36067
FF:	N
NPL:	Not on the NPL
Non NPL Status:	Referred to Removal - NFRAP

SEMS Archive Detail:

Region:	02
Site ID:	0206645
EPA ID:	NYN000206645
Site Name:	ROTH BROS METAL CO.
NPL:	N

ROTH BROS METAL CO. (Continued) **1015754900**

FF:	N
OU:	00
Action Code:	RS
Action Name:	RV ASSESS
SEQ:	1
Start Date:	2015-08-05 05:00:00
Finish Date:	2015-08-05 05:00:00
Qual:	Not reported
Current Action Lead:	EPA Perf
Region:	02
Site ID:	0206645
EPA ID:	NYN000206645
Site Name:	ROTH BROS METAL CO.
NPL:	N
FF:	N
OU:	00
Action Code:	PA
Action Name:	PA
SEQ:	1
Start Date:	2013-05-10 05:00:00
Finish Date:	2013-06-26 05:00:00
Qual:	N
Current Action Lead:	EPA Perf
Region:	02
Site ID:	0206645
EPA ID:	NYN000206645
Site Name:	ROTH BROS METAL CO.
NPL:	N
FF:	N
OU:	00
Action Code:	HX
Action Name:	PRE-CERC
SEQ:	1
Start Date:	Not reported
Finish Date:	2012-11-28 05:00:00
Qual:	Not reported
Current Action Lead:	EPA Perf
Region:	02
Site ID:	0206645
EPA ID:	NYN000206645
Site Name:	ROTH BROS METAL CO.
NPL:	N
FF:	N
OU:	00
Action Code:	DS
Action Name:	DISCVRY
SEQ:	1
Start Date:	2012-11-28 05:00:00
Finish Date:	2012-11-28 05:00:00
Qual:	Not reported
Current Action Lead:	EPA Perf

ROTH BROS METAL CO. (Continued) **1015754900**

Lead Smelter Sites:

Site ID:	0206645
Facility Region Id:	02
Latitude:	Not reported
Longitude:	Not reported
CoC Ind:	Not reported
Contaminant Name:	Not reported
FF Ind:	N
NAI:	N
Non-Primary Site-Sub Type:	Not reported
NPL:	Not on the NPL
Primary Site-Sub Type:	Batteries/scrap metals/secondary smelting/precious metal recovery (Recycling);
Special Initiative:	Not reported

---

35 **PIONEER HOMES** **NY Spills** **S102561170**
ENE **MONROE ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.102 mi.
536 ft.

Relative: **Higher**

Actual: **399 ft.**

SPILLS:

Name:	PIONEER HOMES
Address:	MONROE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9612304 / 1997-06-30
Facility ID:	9612304
Facility Type:	ER
DER Facility ID:	250564
Site ID:	310416
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	1996-12-01
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1997-01-14
CID:	211
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1997-01-14
Spill Record Last Update:	1997-11-25
Spiller Name:	Not reported
Spiller Company:	SYRACUSE HOUSING AUTHORIT
Spiller Address:	516 BURT ST
Spiller Company:	001
Contact Name:	EILEEN GILLIGAN
Latitude:	43.0418049
Longitude:	-76.1422500

PIONEER HOMES (Continued) **S102561170**

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
THIS SPILL MAY BE CROSSED
REFERENCED WITH SPILL NO. 9612359.
Remarks: pcb oil transformer to be removed / some oil has leaked / clean up scheduled for next week 1-21-97

All Materials:
Site ID: 310416
Operable Unit ID: 1043813
Operable Unit: 01
Material ID: 340954
Material Code: 0017A
Material Name: PCB oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Resource Affected: Soil
Oxygenate: Not reported

H36 **INSTITUTE OF TECHNOLOGY** **NY Spills** **S113818613**
NW **258 EAST ADAMS ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.102 mi.
541 ft. **Site 1 of 3 in cluster H**

Relative: **Lower**
Actual: **395 ft.**

SPILLS:
Name: INSTITUTE OF TECHNOLOGY
Address: 258 EAST ADAMS ST
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 1303516 / 2014-07-29
Facility ID: 1303516
Facility Type: ER
DER Facility ID: 439181
Site ID: 484000
DEC Region: 7
Spill Cause: Unknown
Spill Class: B3
SWIS: 3415
Spill Date: 2013-07-02
Investigator: HDWARNER
Referred To: Not reported
Reported to Dept: 2013-07-02
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2013-07-02
Spill Record Last Update: 2014-07-31
Spiller Name: Not reported

INSTITUTE OF TECHNOLOGY (Continued) **S113818613**

Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	CHEYENNE DASHNAW
Latitude:	43.0427021
Longitude:	-76.1495774
DEC Memo:	Not reported
Remarks:	cleanup pending

All Materials:

Site ID:	484000
Operable Unit ID:	1233694
Operable Unit:	01
Material ID:	2232620
Material Code:	0017A
Material Name:	PCB oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

H37 **SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDIN** **PA MANIFEST** **S112070198**
NW **258 E ADAMS ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.102 mi.
541 ft. **Site 2 of 3 in cluster H**

Relative: **Lower**

Actual: **395 ft.**

PA MANIFEST:

Name:	SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDING
Address:	258 E ADAMS ST
City,State,Zip:	SYRACUSE, NY 13202
Year:	2011
Manifest Number:	003548385FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D001
Container Number:	1
Container Type:	CF
Waste Quantity:	428
Unit:	P
Handling Code:	Not reported

SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDING (Continued) **S112070198**

TSP EPA ID:	Not reported
Date TSP Sig:	Not reported
Year:	2011
Manifest Number:	003548385FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	2
Waste Number:	D002
Container Number:	1
Container Type:	DM
Waste Quantity:	152
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported
Year:	2011
Manifest Number:	003548385FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	3
Waste Number:	D010
Container Number:	1
Container Type:	DF
Waste Quantity:	4
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported
Year:	2011
Manifest Number:	003548385FLE

SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDING (Continued) **S112070198**

Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	4
Waste Number:	D002
Container Number:	1
Container Type:	DF
Waste Quantity:	180
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D002
Container Number:	1
Container Type:	DF
Waste Quantity:	3
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported

SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDING (Continued) **S112070198**

Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	U122
Container Number:	1
Container Type:	DF
Waste Quantity:	3
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D001
Container Number:	1
Container Type:	DF
Waste Quantity:	3
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE

SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDING (Continued) **S112070198**

TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	2
Waste Number:	D007
Container Number:	1
Container Type:	DF
Waste Quantity:	3
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported
Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	2
Waste Number:	D001
Container Number:	1
Container Type:	DF
Waste Quantity:	3
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported
Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	3

SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDING (Continued) **S112070198**

Waste Number:	D002
Container Number:	1
Container Type:	DF
Waste Quantity:	23
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported
Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	3
Waste Number:	D007
Container Number:	1
Container Type:	DF
Waste Quantity:	23
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

Click this hyperlink while viewing on your computer to access
2 additional PA MANIFEST: record(s) in the EDR Site Report.

H38 **INSTITUTE OF TECHNOLOGY** **RCRA NonGen / NLR** **1000705550**
NW **258 E ADAMS ST** **NY MANIFEST** **NYD986981520**
< 1/8 **SYRACUSE, NY 13210**
0.102 mi.
541 ft. **Site 3 of 3 in cluster H**

Relative: RCRA Listings:
Lower

Actual: Date Form Received by Agency:	20150626
395 ft. Handler Name:	Institute Of Technology
Handler Address:	E Adams St
Handler City,State,Zip:	SYRACUSE, NY 13210
EPA ID:	NYD986981520
Contact Name:	RICHARD L LAW
Contact Address:	SCHUYLER RD
Contact City,State,Zip:	EAST SYRACUSE, NY 13057
Contact Telephone:	315-437-5906 x1
Contact Fax:	315-437-3650
Contact Email:	RLAW@RHLAWINC.COM
Contact Title:	PRESIDENT - ROBERT H LAW INC
EPA Region:	02

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Land Type:	District
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	E ADAMS ST
Mailing City,State,Zip:	SYRACUSE, NY 13210
Owner Name:	City Of Syracuse Central
Owner Type:	District
Operator Name:	Sharon L Contreras
Operator Type:	District
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150626
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Hazardous Waste Summary:
Waste Code: D000
Waste Description: Not Defined

Waste Code: D001
Waste Description: Ignitable Waste

Waste Code: D008
Waste Description: Lead

Waste Code: D009
Waste Description: Mercury

Handler - Owner Operator:
Owner/Operator Indicator: Operator
Owner/Operator Name: SHARON L CONTRERAS
Legal Status: District
Date Became Current: 20110701
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SYRACUSE CITY SCHOOL DIST
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 725 HARRISON ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-435-4292
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SHARON L CONTRERAS
Legal Status: District
Date Became Current: 20110701
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE CITY SCHOOL DIST
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 725 HARRISON ST

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-435-4292
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: CITY OF SYRACUSE CENTRAL
Legal Status: District
Date Became Current: 19570101
Date Ended Current: Not reported
Owner/Operator Address: 725 HARRISON ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-435-4499
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: CITY OF SYRACUSE CENTRAL
Legal Status: District
Date Became Current: 19570101
Date Ended Current: Not reported
Owner/Operator Address: 725 HARRISON ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-435-4499
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE CITY SCHOOL DIST
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 725 HARRISON ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-435-4292
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20060101
Handler Name: SYRACUSE CITY SCH DIST - CENTRAL TECH
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Handler Name: SYRACUSE CITY SCH DIST - CENTRAL TECH
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150626
Handler Name: INSTITUTE OF TECHNOLOGY
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19960229
Handler Name: SYRACUSE CITY SCH DIST - CENTRAL TECH
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20131226
Handler Name: INSTITUTE OF TECHNOLOGY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 611110
NAICS Description: ELEMENTARY AND SECONDARY SCHOOLS

Facility Has Received Notices of Violations:

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

NY MANIFEST:

EPA ID:	NYD986981520
Country:	USA
Name:	CENTRAL TECH SCHOOL
Address:	258 E ADAMS ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	258 EAST ADAMS STREET
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13210
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	CENTRAL TECH SCHOOL
Mailing Contact:	NICK DIBELLO
Mailing Address 1:	258 EAST ADAMS STREET
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154354292

Manifest Data:

Document ID:	MAM9877680
Manifest Status:	Not reported
Trans1 State ID:	NYLJ5601
Year:	2001
Trans2 State ID:	3944
Generator Ship Date:	10/17/2001
Trans1 Recv Date:	10/17/2001
Trans2 Recv Date:	10/18/2001
TSD Site Recv Date:	10/24/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	SCR000075150
Trans2 EPA ID:	MOD095038898
TSDF ID 1:	MAD982755639
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	SILVER
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00045
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYC6172773
Manifest Status:	Not reported
Trans1 State ID:	NYNF6376
Year:	2000
Trans2 State ID:	Not reported
Generator Ship Date:	06/14/2000
Trans1 Recv Date:	06/14/2000
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/15/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	SCR000075150
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00017
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Specific Gravity: 01.00
Waste Code 7: TETRACHLOROETHYLENE
Waste Code 8: Not reported
Waste Code: Not reported
Waste Code 10: Not reported
Waste Code 11: Not reported
Quantity: 00005
Units: Gallons (liquids only)
Number of Containers: 001
Container Type: Fiberboard or plastic drums, barrels, kegs
Handling Method: Treat
Specific Gravity: 01.00

Document ID: NYC5537632
Manifest Status: Not reported
Trans1 State ID: NYNF6576
Year: 1999
Trans2 State ID: Not reported
Generator Ship Date: 03/22/1999
Trans1 Recv Date: 03/22/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 03/23/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986981520
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID 1: NYD982743312
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: TETRACHLOROETHYLENE
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00005
Units: Gallons (liquids only)
Number of Containers: 001
Container Type: Fiberboard or plastic drums, barrels, kegs
Handling Method: Treat
Specific Gravity: 01.00

Document ID: NYC7555061
Manifest Status: Not reported
Trans1 State ID: NY16607JJ

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Year:	2005
Trans2 State ID:	Not reported
Generator Ship Date:	01/20/2005
Trans1 Recv Date:	01/20/2005
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/21/2005
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	TXR000050930
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	TETRACHLOROETHYLENE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00034
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	TETRACHLOROETHYLENE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	06/19/2008
Trans1 Recv Date:	06/19/2008
Trans2 Recv Date:	Not reported

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

TSD Site Recv Date:	06/19/2008
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	000745823SKS
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	TETRACHLOROETHYLENE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/24/2006
Trans1 Recv Date:	02/24/2006
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/24/2006
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	NYC7660675
Import Indicator:	N

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code a:	TETRACHLOROETHYLENE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	30
Units:	Gallons (liquids only)
Number of Containers:	2
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	0.8

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/24/2006
Trans1 Recv Date:	02/24/2006
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/24/2006
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	NYC7660675
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Waste Code a:	TETRACHLOROETHYLENE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/24/2006
Trans1 Recv Date:	02/24/2006
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/24/2006
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	NYC7660675
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code a:	IGNITABLE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	15
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/22/2008
Trans1 Recv Date:	02/22/2008
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/22/2008
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	000745540SKS
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	IGNITABLE WASTE
Waste Code b:	BENZENE
Waste Code c:	TETRACHLOROETHYLENE
Waste Code e:	TRICHLORETHYLENE
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	15
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	1
Document ID:	Not reported

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/22/2008
Trans1 Recv Date:	02/22/2008
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/22/2008
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	000745540SKS
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	TETRACHLOROETHYLENE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	30
Units:	Gallons (liquids only)
Number of Containers:	2
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/22/2008
Trans1 Recv Date:	02/22/2008
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/22/2008
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	000745540SKS
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	TETRACHLOROETHYLENE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	1

Click this hyperlink while viewing on your computer to access
63 additional NY MANIFEST: record(s) in the EDR Site Report.

F39 **ONON.CO. PARKING GARAGE** **NY Spills** **S102678032**
North **ADDAMS ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.105 mi.
554 ft. **Site 9 of 9 in cluster F**

Relative: **Lower**

Actual: **396 ft.**

SPILLS:

Name:	ONON.CO. PARKING GARAGE
Address:	ADDAMS ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9206683 / 1992-09-16
Facility ID:	9206683
Facility Type:	ER
DER Facility ID:	234124
Site ID:	289096
DEC Region:	7
Spill Cause:	Other
Spill Class:	E6

ONON.CO. PARKING GARAGE (Continued) **S102678032**

SWIS:	3415
Spill Date:	1992-09-09
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1992-09-09
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Affected Persons
Cleanup Ceased:	1992-09-09
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	Not reported
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 09/16/92: TANK EXCAVATED AND CLEANED. NO SIGNIFICANT RELEASE OF PETROLEUM.
Remarks:	UNDERGROUND TANK DISCOVERED WHEN GRADING RD.

All Materials:

Site ID:	289096
Operable Unit ID:	973827
Operable Unit:	01
Material ID:	407380
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

I40 **DI PINO ANTHONY** **EDR Hist Auto** **1021064592**
South **1117 SOUTH STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.107 mi.
564 ft. **Site 1 of 2 in cluster I**

Relative: EDR Hist Auto
Higher

Actual:
399 ft.

Year:	Name:	Type:
1969	DI PINO ANTHONY	Gasoline Service Stations
1969	HALLIDAY HARRY B	General Automotive Repair Shops
1970	HALLIDAY HARRY B	General Automotive Repair Shops
1970	DI PINO ANTHONY	Gasoline Service Stations

DI PINO ANTHONY (Continued) **1021064592**

1971	HALLIDAY HARRY B	General Automotive Repair Shops
1971	DI PINO ANTHONY	Gasoline Service Stations
1972	DI PINO ANTHONY	Gasoline Service Stations
1972	HALLIDAY HARRY B	General Automotive Repair Shops
1973	HALLIDAY HARRY B	General Automotive Repair Shops
1973	DI PINO ANTHONY	Gasoline Service Stations
1974	HALLIDAY HARRY B	General Automotive Repair Shops
1974	DI PINO ANTHONY	Gasoline Service Stations
1975	HALLIDAY HARRY B	General Automotive Repair Shops
1975	DI PINO ANTHONY	Gasoline Service Stations
1976	HALLIDAY HARRY B	General Automotive Repair Shops
1976	DI PINO ANTHONY	Gasoline Service Stations
1977	HALLIDAY HARRY B	General Automotive Repair Shops
1977	DI PINO ANTHONY	Gasoline Service Stations

I41 **FORMER SALVATION ARMY PROPERTY** **NY UST** **U004046802**
South **1117 SOUTH STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.107 mi.
564 ft. **Site 2 of 2 in cluster I**

Relative:
Higher

Actual:
399 ft.

UST:

Name:	FORMER SALVATION ARMY PROPERTY
Address:	1117 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-601001 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	406603.83375
UTM Y:	4765746.98664
Site Type:	Other

Affiliation Records:

Site Id:	333717
Affiliation Type:	Mail Contact
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	DAVID FICKENSHER
Address1:	516 BURT ST.
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 475-6181
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DJLASALL
Date Last Modified:	2004-11-17

Site Id:	333717
Affiliation Type:	Facility Operator
Company Name:	FORMER SALVATION ARMY PROPERTY
Contact Type:	Not reported
Contact Name:	N\\A
Address1:	Not reported

FORMER SALVATION ARMY PROPERTY (Continued) **U004046802**

Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 475-6181
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DJLASALL
Date Last Modified:	2004-11-17

Site Id:	333717
Affiliation Type:	Emergency Contact
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	N\\A
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 475-6181
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DJLASALL
Date Last Modified:	2004-11-17

Site Id:	333717
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	516 BURT ST.
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 475-6181
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DJLASALL
Date Last Modified:	2004-11-17

Tank Info:

Tank Number:	001
Tank ID:	180870
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	1000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel

FORMER SALVATION ARMY PROPERTY (Continued) **U004046802**

Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

J00 - Dispenser - None
L00 - Piping Leak Detection - None
K00 - Spill Prevention - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
E00 - Piping Secondary Containment - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None

Tank Number: 002
Tank ID: 180871
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 1000
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

J00 - Dispenser - None
L00 - Piping Leak Detection - None
K00 - Spill Prevention - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
E00 - Piping Secondary Containment - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None

FORMER SALVATION ARMY PROPERTY (Continued) **U004046802**

Tank Number:	003
Tank ID:	180872
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	1000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0000
Common Name of Substance:	Empty
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

J00 - Dispenser - None
L00 - Piping Leak Detection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
K00 - Spill Prevention - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground

Tank Number:	004
Tank ID:	180873
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	1000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0000
Common Name of Substance:	Empty
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

J00 - Dispenser - None
L00 - Piping Leak Detection - None

FORMER SALVATION ARMY PROPERTY (Continued) **U004046802**

K00 - Spill Prevention - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
E00 - Piping Secondary Containment - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None

G42 **INTERSECTION OF** **NY Spills** **S107787451**
SE **EAST TAYLOR/SOUTH MCBRIDE** **N/A**
< 1/8 **SYRACUSE, NY**
0.109 mi.
575 ft. **Site 2 of 15 in cluster G**

Relative: **Higher**
Actual: **406 ft.**

SPILLS:

Name:	INTERSECTION OF
Address:	EAST TAYLOR/SOUTH MCBRIDE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0600689 / 2006-04-19
Facility ID:	0600689
Facility Type:	ER
DER Facility ID:	312985
Site ID:	362754
DEC Region:	7
Spill Cause:	Other
Spill Class:	D3
SWIS:	3415
Spill Date:	2006-04-18
Investigator:	KCKemp
Referred To:	Not reported
Reported to Dept:	2006-04-18
CID:	444
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	2006-04-19
Cleanup Meets Std:	True
Last Inspection:	2006-04-18
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2006-04-18
Spill Record Last Update:	2006-04-19
Spiller Name:	GLENN WILLIAMS
Spiller Company:	NATIONAL GRID
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	001
Contact Name:	GLENN WILLIAMS
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	cleaned up by optech. no stains noted.
Remarks:	THEY WERE REELING HOSE AND OI LEAKED OUT AND OPTECH IS ENROUTE TO CLEAN UP

All Materials:

INTERSECTION OF (Continued) **S107787451**

Site ID:	362754
Operable Unit ID:	1120827
Operable Unit:	01
Material ID:	2110318
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

G43 **TAYLOR & MCBRIDE ST.- PCB** **NY Spills** **S103567303**
SE **TAYLOR AND MCBRIDE ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.112 mi.
592 ft. **Site 3 of 15 in cluster G**

Relative: **Higher**

Actual: **406 ft.**

SPILLS:

Name:	TAYLOR & MCBRIDE ST.- PCB
Address:	TAYLOR AND MCBRIDE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9107234 / 1991-11-12
Facility ID:	9107234
Facility Type:	ER
DER Facility ID:	230968
Site ID:	284835
DEC Region:	7
Spill Cause:	Other
Spill Class:	Not reported
SWIS:	3415
Spill Date:	1991-10-05
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1991-10-05
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Affected Persons
Cleanup Ceased:	1991-10-07
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1991-10-07
Spill Record Last Update:	1991-11-12
Spiller Name:	Not reported
Spiller Company:	NIAGRA MOHAWK POWER CO.
Spiller Address:	300 ERIE BLVD.
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0394460
Longitude:	-76.1438868
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR

TAYLOR & MCBRIDE ST.- PCB (Continued) **S103567303**

Remarks: 10/07/91: NIMO PERSONEL PERFORMING CLEANUP. TO SEND CLOSURE REPORT W/SAMPLING RESULT FROM SPILL SITE. 11/12/91: REC'D DOCUMENTATION REPORT REGARDING CLEANUP FROM NIAGRA-MOHAWK. BLDG. CONSTRUCTION PROJECT COLLASPED BRINGING DOWN THREE UTILITY POLES. ONE TRANSFORMER LEAKED WHEN IT HIT THE GROUND.

All Materials:

Site ID:	284835
Operable Unit ID:	957577
Operable Unit:	01
Material ID:	419452
Material Code:	0017A
Material Name:	PCB oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20.00
Units:	G
Recovered:	19.00
Resource Affected:	Soil
Oxygenate:	Not reported

G44 **E. TAYLOR AND MCBRIDE ST.** **NY Spills** **S102165193**
SE **EAST TAYLOR AND MCBRIDE** **N/A**
< 1/8 **SYRACUSE, NY**
0.112 mi.
592 ft. **Site 4 of 15 in cluster G**

Relative: **Higher**

Actual: **406 ft.**

SPILLS:

Name:	E. TAYLOR AND MCBRIDE ST.
Address:	EAST TAYLOR AND MCBRIDE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9204042 / 1992-07-08
Facility ID:	9204042
Facility Type:	ER
DER Facility ID:	196313
Site ID:	238382
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	E6
SWIS:	3415
Spill Date:	1992-07-08
Investigator:	RJBRAZEL
Referred To:	Not reported
Reported to Dept:	1992-07-08
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Citizen
Cleanup Ceased:	1992-07-08
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1992-07-20
Spill Record Last Update:	1993-04-06

E. TAYLOR AND MCBRIDE ST. (Continued) **S102165193**

Spiller Name:	Not reported
Spiller Company:	NO NAME CONSTRUCTION CO
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0394460
Longitude:	-76.1438868
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was RB 09/28/95: This is additional information about material spilled from the translation of the old spill file: HEAVY YELLOW SMOKE.
Remarks:	CALLER AND SEVERAL OTHER BUSINESS PEOPLE IN THE VICINITY ARE CONCERNEDBECAUSE SMALL CHILDREN ARE PLAYING IN THE AREA

All Materials:

Site ID:	238382
Operable Unit ID:	971435
Operable Unit:	01
Material ID:	411798
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Air
Oxygenate:	Not reported

G45 **STEAM HEAT SYR. UNIVERS.** **NY Spills** **S102164496**
ESE **TALOR & MCBRIDE ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.116 mi.
613 ft. **Site 5 of 15 in cluster G**

Relative:
Higher

Actual:
405 ft.

SPILLS:

Name:	STEAM HEAT SYR. UNIVERS.
Address:	TALOR & MCBRIDE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8801654 / 1995-02-09
Facility ID:	8801654
Facility Type:	ER
DER Facility ID:	211093
Site ID:	257809
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	B3
SWIS:	3415
Spill Date:	1988-05-23
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	1988-05-23
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Affected Persons
Cleanup Ceased:	1995-02-09

STEAM HEAT SYR. UNIVERS. (Continued) **S102164496**

Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1988-06-07
Spill Record Last Update:	1995-02-09
Spiller Name:	Not reported
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	Not reported
Latitude:	43.0394460
Longitude:	-76.1438868
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was HW 01/19/89: DEC MONITORING THE CLEANUP EFFORTS. 04/12/91: NEW FUEL STORAGE TANKS WERE INSTALLED BY SU DURING SUMMER OF 90. LARGE QUANTITY OF CONTAMINATED SOIL REMOVED. STAN TALLET OF STEAM STATION CURRENTLY MONITORING. 06/19/91: MET STAN TALLET AT SITE CHECKED WELL ADJACENT TO RECOVERY SYSTEM FORPRODUCT. LAYER OF FUEL STILL PRESENT IN WELL. SU TO EXCAVATE AROUND WELL SOMTIME IN JULY. 02/07/92: MEETING AT STEAM STATION SU WILL DO SOIL BORINGS BEFORE EXCAVATING SOIL. WORK SCHEDULED FOR 02/06/92. CRAIG BUTLER OF ES HANDLING PROJECT. 06/27/92: SOIL EXCAVATED AREA OF APPROX 15’ BY 20’ REMOVED GARY DYER HAULED CONTAMINATED SOIL. ES ON SITE TO OVER SEE EXCAVATION, WILL SEND CLOSURE REPORT.
Remarks:	BARRY KOUGOT 422-0121. DRILLING AND HIT OIL. 6 TO 18 OF FUEL OILON GROUND WATER. FOUND ABANDONED 15K TANK ;FULL OF WATER AND FUEL OIL.

All Materials:

Site ID:	257809
Operable Unit ID:	917147
Operable Unit:	01
Material ID:	460784
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

G46 **SU CHILLED WATER PLANT** **NY AST** **S100346926**
SE **500 E. TAYLOR STREET** **NY CBS AST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.116 mi.
613 ft. **Site 6 of 15 in cluster G**

Relative:
Higher

Actual:
406 ft.

AST:

Name:	SU CHILLED WATER PLANT
Address:	500 E. TAYLOR STREET
City,State,Zip:	SYRACUSE, NY 13202
Region:	STATE
DEC Region:	7
Site Status:	Unregulated/Closed
Facility Id:	7-000281
Program Type:	CBS
UTM X:	406826.97609
UTM Y:	4765824.13209
Expiration Date:	N/A
Site Type:	School

Tank Info:

Tank Number:	002
Tank Id:	192050
Tank Location:	Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.
Tank Type:	Stainless Steel Alloy
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	10/01/1996
Capacity Gallons:	1100
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	11/01/1999
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

Tank Number:	003
Tank Id:	192051
Tank Location:	Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.
Tank Type:	Plastic
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	10/01/1996
Capacity Gallons:	500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	11/01/1999
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

SU CHILLED WATER PLANT (Continued) **S100346926**

CBS AST:

CBS Number:	7-000281
ICS Number:	Not reported
PBS Number:	7-180602
MOSF Number:	Not reported
SPDES Number:	Not reported
Facility Status:	IN SERVICE
Facility Type:	G
Telephone:	(315) 443-4188
Facility Town:	SYRACUSE (C)
Region:	STATE
Expiration Date:	10/09/2000
Total Capacity of All Active Tanks(gal):	0
Operator:	SYRACUSE UNIVERSITY
Emergency Contact:	TOM REDDINGER
Emergency Phone:	(315) 443-4188
Owner Name:	SYRACUSE UNIVERSITY
Owner Address:	SKYTOP ROAD
Owner City,St,Zip:	SYRACUSE, NY 13244
Owner Telephone:	(315) 443-8230
Owner Type:	Corporate/Commercial
Owner Sub Type:	Not reported
Mail Name:	SYRACUSE UNIVERSITY
Mail Contact Addr:	EHO O29 LYMAN HALL
Mail Contact Addr2:	100 COLLEGE PLACE
Mail Contact Contact:	JAMES MCCUMBER
Mail Contact City,St,Zip:	SYRACUSE, NY 13244
Mail Phone:	(315) 443-4132

Tank Id:	003
CAS Number:	7681529
Federal ID:	Not reported
Tank Status:	0
Install Date:	10/96
Tank Closed:	11/99
Capacity (Gal):	500
Chemical:	Sodium hypochlorite
Tank Location:	Indoors, Aboveground
Tank Type:	Fiberglass reinforced plastic [FRP]
Total Tanks:	0
Tank Secret:	False
Tank Secondary Containment:	01
Tank Error Status:	No Missing Data
Date Entered:	10/09/1996
Certified Date:	08/31/1998
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None,None
Pipe Location:	Aboveground
Pipe Type:	Double Walled Fiberglass
Pipe Internal:	None
Pipe External:	00
Pipe Flag:	00
Leak Detection:	01
Overfill Protection:	04
Haz Percent:	12
Last Test:	Not reported

SU CHILLED WATER PLANT (Continued) **S100346926**

Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	Not reported
Is It There:	False
Delinquent:	False
Date Expired:	Not reported
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True
Pre-Printed Renewal App Last Printed:	07/05/2000

Tank Id:	002
CAS Number:	7664939
Federal ID:	Not reported
Tank Status:	0
Install Date:	10/96
Tank Closed:	11/99
Capacity (Gal):	1100
Chemical:	Sulfuric acid
Tank Location:	Indoors, Aboveground
Tank Type:	Stainless steel alloy
Total Tanks:	0
Tank Secret:	False
Tank Secondary Containment:	01
Tank Error Status:	No Missing Data
Date Entered:	10/09/1996
Certified Date:	08/31/1998
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	Other
External Protection:	None,None
Pipe Location:	None
Pipe Type:	Steel/Iron
Pipe Internal:	Other
Pipe External:	00
Pipe Flag:	00
Leak Detection:	01
Overfill Protection:	02
Haz Percent:	93
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	Not reported
Is It There:	False
Delinquent:	False
Date Expired:	Not reported
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True
Pre-Printed Renewal App Last Printed:	07/05/2000

G47 **SYRACUSE UNIVERSITY STEAM STATION** **NY CBS AST** **U003077914**
SE **500 E. TAYLOR STREET** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.116 mi.
613 ft. **Site 7 of 15 in cluster G**

Relative:
Higher

Actual:
406 ft.

CBS AST:

CBS Number:	7-000152
ICS Number:	7-700483
PBS Number:	7-180602
MOSF Number:	Not reported
SPDES Number:	Not reported
Facility Status:	IN SERVICE
Facility Type:	G
Telephone:	(315) 474-8230
Facility Town:	SYRACUSE (C)
Region:	STATE
Expiration Date:	07/18/2003
Total Capacity of All Active Tanks(gal):	1500
Operator:	JOSEPH BURROUGHS
Emergency Contact:	JOSEPH BURROUGHS
Emergency Phone:	(315) 474-8230
Owner Name:	SYRACUSE UNIVERSITY
Owner Address:	SKYTOP ROAD
Owner City,St,Zip:	SYRACUSE, NY 13244-6400
Owner Telephone:	(315) 443-4188
Owner Type:	Corporate/Commercial
Owner Sub Type:	Not reported
Mail Name:	PROJECT ORANGE ASSOCIATES, L.P.
Mail Contact Addr:	507 PLUM ST
Mail Contact Addr2:	NIAGARA MOHAWK ENERGY MARKETING
Mail Contact Contact:	JAMES CIFARATTA
Mail Contact City,St,Zip:	SYRACUSE, NY 13204
Mail Phone:	(315) 460-3379
Tank Id:	004
CAS Number:	75718
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	12/70
Tank Closed:	00/00
Capacity (Gal):	1000
Chemical:	Methane, dichlorodifluoro-
Tank Location:	Indoors, Belowground
Tank Type:	Steel/carbon steel
Total Tanks:	1
Tank Secret:	False
Tank Secondary Containment:	00
Tank Error Status:	No Missing Data
Date Entered:	03/16/1992
Certified Date:	06/18/2001
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None,Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Unknown
Pipe Internal:	None
Pipe External:	01
Pipe Flag:	01

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U003077914**

Leak Detection:	01
Overfill Protection:	04
Haz Percent:	99
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	04/01/93
Is It There:	False
Delinquent:	False
Date Expired:	07/18/95
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True
Pre-Printed Renewal App Last Printed:	03/30/2001

Tank Id:	001
CAS Number:	7664939
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	06/72
Tank Closed:	Not reported
Capacity (Gal):	1500
Chemical:	Sulfuric acid
Tank Location:	Indoors, Belowground
Tank Type:	Steel/carbon steel
Total Tanks:	1
Tank Secret:	False
Tank Secondary Containment:	01
Tank Error Status:	No Missing Data
Date Entered:	07/18/1989
Certified Date:	06/18/2001
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None,Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	01
Pipe Flag:	01
Leak Detection:	00
Overfill Protection:	04
Haz Percent:	93
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	04/01/93
Is It There:	False
Delinquent:	False
Date Expired:	07/18/95
Owner Mark:	1
Certificate Needs to be Printed:	False

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U003077914**

Fiscal Amt for Registration Fee Correct: True
Renewal Has Been Printed for Facility: True
Pre-Printed Renewal App Last Printed: 03/30/2001

Tank Id:	003
CAS Number:	60004
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	02/91
Tank Closed:	00/00
Capacity (Gal):	1000
Chemical:	Ethylenediamine tetraacetic acid (EDTA)
Tank Location:	Indoors, Belowground
Tank Type:	Fiberglass reinforced plastic [FRP]
Total Tanks:	1
Tank Secret:	False
Tank Secondary Containment:	01
Tank Error Status:	No Missing Data
Date Entered:	04/03/1991
Certified Date:	06/18/2001
Substance:	More than one Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None,None
Pipe Location:	Aboveground
Pipe Type:	Wrapped Steel
Pipe Internal:	None
Pipe External:	00
Pipe Flag:	00
Leak Detection:	00
Overfill Protection:	04
Haz Percent:	30
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	04/01/93
Is It There:	False
Delinquent:	False
Date Expired:	07/18/95
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True
Pre-Printed Renewal App Last Printed:	03/30/2001

Tank Id:	002
CAS Number:	60004
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	02/91
Tank Closed:	00/00
Capacity (Gal):	1000
Chemical:	Ethylenediamine tetraacetic acid (EDTA)
Tank Location:	Indoors, Belowground

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U003077914**

Tank Type:	Fiberglass reinforced plastic [FRP]
Total Tanks:	1
Tank Secret:	False
Tank Secondary Containment:	01
Tank Error Status:	No Missing Data
Date Entered:	04/03/1991
Certified Date:	06/18/2001
Substance:	More than one Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None,None
Pipe Location:	Aboveground
Pipe Type:	Wrapped Steel
Pipe Internal:	None
Pipe External:	00
Pipe Flag:	00
Leak Detection:	00
Overfill Protection:	04
Haz Percent:	30
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	04/01/93
Is It There:	False
Delinquent:	False
Date Expired:	07/18/95
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True
Pre-Printed Renewal App Last Printed:	03/30/2001

G48 **SYRACUSE UNIVERSITY STEAM STATION** **NY CBS** **S102166574**
SE **500 EAST TAYLOR STREET** **NY AST** **N/A**
< 1/8 **SYRACUSE, NY 13202** **NY Spills**
0.116 mi. **NY MANIFEST**
613 ft. **Site 8 of 15 in cluster G**

Relative: **Higher**

Actual: **406 ft.**

CBS:

Name:	SYRACUSE UNIVERSITY STEAM STATION
Address:	500 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY 13202
CBS Number:	7-000152
Program Type:	CBS
Facility Status:	Unregulated/Closed
Expiration Date:	Not reported
Dec Region:	7
UTMX:	406899.41504
UTMY:	4765790.33863

Name:	SU CHILLED WATER PLANT
Address:	500 E. TAYLOR STREET
City,State,Zip:	SYRACUSE, NY 13202
CBS Number:	7-000281
Program Type:	CBS
Facility Status:	Unregulated/Closed
Expiration Date:	Not reported

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

Dec Region: 7
UTMX: 406826.97609
UTMY: 4765824.13209

AST:
Name: SYRACUSE UNIVERSITY STEAM STATION
Address: 500 EAST TAYLOR STREET
City,State,Zip: SYRACUSE, NY 13202
Region: STATE
DEC Region: 7
Site Status: Unregulated/Closed
Facility Id: 7-000152
Program Type: CBS
UTM X: 406899.41504
UTM Y: 4765790.33863
Expiration Date: N/A
Site Type: School

Tank Info:

Tank Number: 001
Tank Id: 187570
Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 06/01/1972
Capacity Gallons: 1500
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 06/16/2011
Register: True
Modified By: MJGRIFFI
Last Modified: 05/09/2022
Material Name: Not reported

Tank Number: 002
Tank Id: 195960
Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type: Plastic
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 02/01/2003
Capacity Gallons: 200
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 10/30/2009
Register: True
Modified By: MJGRIFFI
Last Modified: 05/09/2022
Material Name: Not reported

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

Tank Number:	002-A
Tank Id:	195961
Tank Location:	Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type:	Fiberglass Reinforced Plastic
Tank Status:	Tank Converted to Non-Regulated Use
Pipe Model:	Not reported
Install Date:	02/01/1991
Capacity Gallons:	1000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

Tank Number:	003
Tank Id:	195962
Tank Location:	Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type:	Plastic
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	02/01/2004
Capacity Gallons:	200
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	10/30/2009
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

Tank Number:	003-A
Tank Id:	195963
Tank Location:	Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type:	Fiberglass Reinforced Plastic
Tank Status:	Tank Converted to Non-Regulated Use
Pipe Model:	Not reported
Install Date:	02/01/1991
Capacity Gallons:	1000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

Tank Number:	004
Tank Id:	190059
Tank Location:	Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Tank Converted to Non-Regulated Use
Pipe Model:	Not reported
Install Date:	12/01/1970
Capacity Gallons:	1000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

SPILLS:

Name:	SYRACUSE UNIVERSITY
Address:	500 E TAYLOR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1902943 / 2020-03-27
Facility ID:	1902943
Facility Type:	ER
DER Facility ID:	541078
Site ID:	590889
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	B4
SWIS:	3415
Spill Date:	2019-06-21
Investigator:	CFNORRIS
Referred To:	Not reported
Reported to Dept:	2019-06-21
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2019-06-21
Spill Record Last Update:	2020-03-27
Spiller Name:	Not reported
Spiller Company:	MCGINNIS NELSON CONTRACTOR
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	CHAD AMES
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Spill to stone below sidewalk during replacement of sidewalk pavers. Incident report to be sent over soon. 1/21/2019 I spoke to Chad Ames, SU Health and Safety. He

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

	will be sending the incident
	report and disposal information, hopefully today. REPORT RECEIVED
Remarks:	loss to crushed stone, c/u in progress

All Materials:

Site ID:	590889
Operable Unit ID:	1338515
Operable Unit:	01
Material ID:	2348010
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	2.00
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	SU STEAM STATION
Address:	500 E TAYLOR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9008107 / 1990-10-24
Facility ID:	9008107
Facility Type:	ER
DER Facility ID:	280417
Site ID:	161896
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	Not reported
SWIS:	3400
Spill Date:	1990-10-24
Investigator:	DJLASALL
Referred To:	Not reported
Reported to Dept:	1990-10-24
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	1990-10-24
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	SU STEAM STATION
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0389813
Longitude:	-76.1429976
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was DL
Remarks:	PLANT PERSONNEL USED PADS TO CLEAN UP AND DISPOSED OF SAME.

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

All Materials:

Site ID:	161896
Operable Unit ID:	945310
Operable Unit:	01
Material ID:	559262
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	2.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

NY MANIFEST:

EPA ID:	NYD982271918
Country:	USA
Name:	SYRACUSE UNIVERSITY STEAM STATION
Address:	500 E TAYLOR ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13244
Zip 4:	Not reported
Location Address 1:	500 EAST TAYLOR STREET
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13244
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	SYRACUSE UNIVERSITY STEAM STATION
Mailing Contact:	BRIAN FITZPATRICK
Mailing Address 1:	108 COLLEGE PLACE
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13244
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154233328

Manifest Data:

Document ID:	ILA7829484
Manifest Status:	Not reported
Trans1 State ID:	UPW018074
Year:	1999
Trans2 State ID:	UPW012400
Generator Ship Date:	07/28/1999
Trans1 Recv Date:	07/28/1999
Trans2 Recv Date:	07/30/1999
TSD Site Recv Date:	08/04/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	MAD039322250

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

Trans2 EPA ID:	OHD009865825
TSDF ID 1:	ILD000608471
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00440
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYC3311436
Manifest Status:	Not reported
Trans1 State ID:	NYAM6504
Year:	1994
Trans2 State ID:	Not reported
Generator Ship Date:	10/25/1994
Trans1 Recv Date:	10/25/1994
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/26/1994
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00021
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYC2998721
Manifest Status:	Not reported
Trans1 State ID:	NYLJ5601
Year:	1994
Trans2 State ID:	Not reported
Generator Ship Date:	02/14/1994
Trans1 Recv Date:	02/14/1994
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/15/1994
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00017
Units:	Gallons (liquids only)

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

Number of Containers: 001
Container Type: Metal drums, barrels, kegs
Handling Method: Recycle
Specific Gravity: 01.00

Document ID: NYC4837792
Manifest Status: Not reported
Trans1 State ID: NYMU2534
Year: 1997
Trans2 State ID: Not reported
Generator Ship Date: 10/07/1997
Trans1 Recv Date: 10/07/1997
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/08/1997
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982271918
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID 1: NYD982743312
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: IGNITABLE WASTE
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00015
Units: Gallons (liquids only)
Number of Containers: 001
Container Type: Metal drums, barrels, kegs
Handling Method: Recycle
Specific Gravity: 01.00

Document ID: NYC4445504
Manifest Status: Not reported
Trans1 State ID: NYNF6576
Year: 1997
Trans2 State ID: Not reported
Generator Ship Date: 01/22/1997
Trans1 Recv Date: 01/22/1997
Trans2 Recv Date: Not reported
TSD Site Recv Date: 01/23/1997
Part A Recv Date: Not reported
Part B Recv Date: Not reported

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

Generator EPA ID:	NYD982271918
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00015
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYC1872843
Manifest Status:	Not reported
Trans1 State ID:	NYDN5385
Year:	1992
Trans2 State ID:	Not reported
Generator Ship Date:	10/09/1992
Trans1 Recv Date:	10/09/1992
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/09/1992
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD000824581
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00086
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD080631369
Year:	2018
Trans2 State ID:	NJD054126164
Generator Ship Date:	10/06/2011
Trans1 Recv Date:	10/06/2011
Trans2 Recv Date:	10/11/2011
TSD Site Recv Date:	10/12/2011
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD980536593
TSDF ID 2:	Not reported
Manifest Tracking Number:	000570816VES
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	MERCURY
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	17
Units:	Pounds
Number of Containers:	1

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

Container Type: Fiberboard or plastic drums, barrels, kegs
Handling Method: Recycle
Specific Gravity: 1

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD080631369
Year: 2018
Trans2 State ID: NJD054126164
Generator Ship Date: 10/06/2011
Trans1 Recv Date: 10/06/2011
Trans2 Recv Date: 10/11/2011
TSD Site Recv Date: 10/12/2011
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982271918
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: NJD980536593
TSDF ID 2: Not reported
Manifest Tracking Number: 000570816VES
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H141
Waste Code a: LEAD
Waste Code b: Not reported
Waste Code c: Not reported
Waste Code e: Not reported
Waste Code f: Not reported
Waste Code g: Not reported
Waste Code 1: Not reported
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 124
Units: Pounds
Number of Containers: 1
Container Type: Metal drums, barrels, kegs
Handling Method: Burn
Specific Gravity: 1

Document ID: NYA5856579
Manifest Status: K - Completed after the designated time
Trans1 State ID: AM8365
Year: 1989
Trans2 State ID: Not reported
Generator Ship Date: 890105

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

Trans1 Recv Date:	900105
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	900105
Part A Recv Date:	900111
Part B Recv Date:	900119
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00605
Units:	Gallons (liquids only)
Number of Containers:	011
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	100

Document ID:	ILA8497054
Manifest Status:	Not reported
Trans1 State ID:	UPW018074
Year:	2000
Trans2 State ID:	UPW012400
Generator Ship Date:	01/20/2000
Trans1 Recv Date:	01/20/2000
Trans2 Recv Date:	01/24/2000
TSD Site Recv Date:	02/01/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	MAD039322250
Trans2 EPA ID:	OHD009865825
TSDF ID 1:	ILD000608471

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00040
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD080631369
Year:	2018
Trans2 State ID:	NYD980769947
Generator Ship Date:	10/03/2013
Trans1 Recv Date:	10/03/2013
Trans2 Recv Date:	10/08/2013
TSD Site Recv Date:	10/09/2013
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	OHD093945293
TSDF ID 2:	Not reported
Manifest Tracking Number:	000609559VES
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N

SYRACUSE UNIVERSITY STEAM STATION (Continued) **S102166574**

Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H061
Waste Code a:	LEAD
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	28
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1

Click this hyperlink while viewing on your computer to access
85 additional NY MANIFEST: record(s) in the EDR Site Report.

G49 **STEAM STATION** **NY Spills** **S123660417**
SE **500 EAST TAYLOR ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.116 mi.
613 ft. **Site 9 of 15 in cluster G**

Relative: **Higher**

Actual: **406 ft.**

SPILLS:

Name:	STEAM STATION
Address:	500 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1810736 / 2019-03-26
Facility ID:	1810736
Facility Type:	ER
DER Facility ID:	424153
Site ID:	581643
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2019-01-23
Investigator:	DJLASALL
Referred To:	Not reported
Reported to Dept:	2019-01-23
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False

STEAM STATION (Continued) **S123660417**

Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2019-01-23
Spill Record Last Update:	2019-03-26
Spiller Name:	Not reported
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	CHAD AMES
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	cleanup completed by RP.
Remarks:	some sprayed outside storage area, most contained. Spill onto crushed stone and snow. clean up in progress.

All Materials:

Site ID:	581643
Operable Unit ID:	1329333
Operable Unit:	01
Material ID:	2338393
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	2.00
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

G50 **SYRACUSE UNIVERSITY - STEAM STATION** **NY LTANKS** **S111258241**
SE **500 EAST TAYLOR ST** **NY Spills** **N/A**
< 1/8 **SYRACUSE, NY 13244** **NY AIRS**
0.116 mi.
613 ft. **Site 10 of 15 in cluster G**

Relative:
Higher

Actual:
406 ft.

LTANKS:

Name:	SYR. U. STEAM STATION
Address:	500 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8605131 / 1988-01-15
Facility ID:	8605131
Site ID:	229011
Spill Date:	1986-11-11
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1988-01-15
SWIS:	3415
Investigator:	WATKINS
Referred To:	Not reported
Reported to Dept:	1986-11-12
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1986-11-25
Spill Record Last Update:	1988-02-10
Spiller Name:	Not reported
Spiller Company:	SYRACUSE U. STEAM STATION
Spiller Address:	500 E. TAYLER ST.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	267351
Latitude:	43.0394104
Longitude:	-76.1437744
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was AW / / : LEAK ON TOP OF TANK. WILL ABANDON TANK BY END OF YR.WILL SEND LETTER WHEN THE WORK BEGINS.
Remarks:	ATLANTIC TESTING DID TANK TEST. LOSING 2 IN MINUTES. ALSO SEE SPILL #86-5148. DUPLICATION.

All Materials:

Site ID:	229011
Operable Unit ID:	902093
Operable Unit:	01
Material ID:	474334
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

Name:	SYRACUSE U. STEAM STATION
Address:	500 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8605148 / 1988-01-15
Facility ID:	8605148
Site ID:	229012
Spill Date:	1986-11-11
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1988-01-15
SWIS:	3415
Investigator:	WATKINS
Referred To:	Not reported
Reported to Dept:	1986-11-12
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1986-11-25
Spill Record Last Update:	1988-02-10
Spiller Name:	Not reported
Spiller Company:	SYRACUSE UNIV. STEAM STA.
Spiller Address:	500 E. TAYLER ST.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	267351
Latitude:	43.0394104
Longitude:	-76.1437744
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was AW
Remarks:	1000 GAL. TANK. FAILURE RATE .8 GALS. PER HOUR. TANK 55 YEARS OLD. SEE ALSO SPILL #86-5131. DUPLICATION.

All Materials:

Site ID:	229012
Operable Unit ID:	902111
Operable Unit:	01
Material ID:	474349
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

SPILLS:

Name:	SYRACUSE U STEAM STATION
Address:	500 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8910992 / 1990-07-09
Facility ID:	8910992
Facility Type:	ER
DER Facility ID:	267351
Site ID:	161895
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	1990-02-17
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	1990-02-19
CID:	Not reported
Water Affected:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	1990-02-19
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1990-03-07
Spill Record Last Update:	1995-03-06
Spiller Name:	Not reported
Spiller Company:	SYRACUSE UNIV
Spiller Address:	500 E TAYLOR
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0394104
Longitude:	-76.1437744
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was HW 07/09/90: VENT LINE LEAKED ON NEWLY INSTALLED UNDERGROUND TANKS. INTERFACE CLEANED UP SMALL AMOUNT OF CONTAMINATED SOIL AND DISPOSED.
Remarks:	VENT LINE RUPTURED.STEAM PALNT PERSONNEL CLEAN UP.

All Materials:

Site ID:	161895
Operable Unit ID:	937992
Operable Unit:	01
Material ID:	440539
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	25.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	SYRACUSE UNVI/ STEAM STATION
Address:	500 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1206833 / 2012-12-04
Facility ID:	1206833
Facility Type:	ER
DER Facility ID:	424153
Site ID:	469851
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	C4
SWIS:	3415
Spill Date:	2012-10-11
Investigator:	MJROMOCK
Referred To:	Not reported
Reported to Dept:	2012-10-11
CID:	Not reported
Water Affected:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2012-10-11
Spill Record Last Update:	2012-12-04
Spiller Name:	BECKY PONZA
Spiller Company:	SYRACUSE UNVI
Spiller Address:	500 EAST TAYLOR ST
Spiller Company:	999
Contact Name:	BECKY PONZA
Latitude:	43.0389813
Longitude:	-76.1429976
DEC Memo:	10/11/2012 - Repairs being done to underground storage tanks. Groundwater being removed from excavtion to effect repairs. 10/25/2012 - Spoke w/ B. Ponza at SU. Contaminated water is being stored on site in frac tank. Water being sampled prior to discharge to sanitary sewer. 11/19/2012 - Rec'd e-mail documenting recent activities regarding GW discharge to Onondaga County sewer. 12/4/2012 - Called B.Ponza at SU. Repairs to tank monitoring system completed.
Remarks:	sheen observed during excavation,tanks present, unk cause, c/u and investigation ongoing

All Materials:

Site ID:	469851
Operable Unit ID:	1219737
Operable Unit:	01
Material ID:	2218270
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Groundwater
Oxygenate:	Not reported

Name:	SYRACUSE UNIVERSITY CHILLED WATER PLANT
Address:	500 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0407665 / 2004-10-13
Facility ID:	0407665
Facility Type:	ER
DER Facility ID:	267351
Site ID:	332190
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Spill Date:	2004-10-11
Investigator:	BFMATTHE
Referred To:	Not reported
Reported to Dept:	2004-10-11
CID:	72
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-10-12
Spill Record Last Update:	2004-11-22
Spiller Name:	JIM MCCUMBER
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	JIM MCCUMBER
Latitude:	43.0394100
Longitude:	-76.1437630
DEC Memo:	SPOKE TO JIM MCCUMBER THEY WOULD LIKE TO NEUTRALIZE AND CLEAN UP. SOME OF SPILL WENT ONTO STATE PROPERTY AND WANTED TO VERIFY IT WAS OK TO ENTER PROPERTY. SPOKE TO DICK BRAZELL AND HE AUTHORIZED. CLEANUP COMPLETE.
Remarks:	Punctured polydrum caused about 20 gallons of sodium hypoclorite (12%) to spill onto asphalt and stone driving area. Spill contained, also went onto adjacent p

All Materials:

Site ID:	332190
Operable Unit ID:	1094447
Operable Unit:	01
Material ID:	574553
Material Code:	0124A
Material Name:	sodium hypochlorite
Case No.:	07681529
Material FA:	Hazardous Material
Quantity:	20.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

AIRS:

Name:	SYRACUSE UNIVERSITY - STEAM STATION
Address:	500 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY 13244
DECID:	7311500204
Process ID:	Not reported
Latitude:	43.039272869
Longitude:	76.143121261
FIPS Code:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Auth Type Code: ATV

Permit Status: Expired
Auth Status Code: Not reported
Emissions: Not reported
Issue date: 02/03/2012
Expired Date: 02/02/2017
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

Permit Status: Issued
Auth Status Code: Not reported
Emissions: Not reported
Issue date: 06/22/2021
Expired Date: 06/21/2026
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

AIRS Detail:
DECID: 7311500204
Facility Name: SYRACUSE UNIVERSITY - STEAM STATION
Auth Type: ATV

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: VOC
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PARTICULATES
Amount(Lbs/Yr): Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	PM-10
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	TOTAL HAP
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	UNSPECIATED PARTICULATES (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	VOC
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	LEAD
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PARTICULATES
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PM-10
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: TOTAL HAP
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: UNSPECIATED PARTICULATES (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: VOC
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: LEAD
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: Not reported
CAS #: Not reported
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PARTICULATES
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PM-10
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: TOTAL HAP
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: UNSPECIATED PARTICULATES (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: VOC
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: Not reported
Contaminant: LEAD
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PARTICULATES
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PM-10
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: TOTAL HAP
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: UNSPECIATED PARTICULATES (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: LEAD
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 0.00450768

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 0.00676152

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 6.1168799999999999E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 7.1363600000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 25538

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440666
Contaminant: ZINC

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	7.3912300000000002
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	3.4141200000000001E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	0.220108
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	0.031444
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	0.1081138
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	0.17185529999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	8.5353000000000002E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	512.11800000000005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	458.76600000000002

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.53454800000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.95788200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 654.37300000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 455.21600000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.3807599999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 4.8366700000000004E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 3.3807599999999998E-4

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date:	Not reported
Year:	2016
CAS #:	000056495
Contaminant:	3-METHYLCHOLANTHRENE
Amount(Lbs/Yr):	4.5876599999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	2.8299599999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	4.55938
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	94.331999999999994
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	170.70599999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	152.922
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	0.01320648
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	13206.48
Issue Date:	Not reported
Expiration Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2016
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 739.726

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 507.11399999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 18866400

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 535.22699999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 450.76799999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 0.33016200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 361.60599999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 1.8866400000000001E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 2162.2759999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 19725

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 139.40989999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.30990299999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440508

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: COPPER
Amount(Lbs/Yr): 0.13363700000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.24183350000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.33016200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 1.251844

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 1.1214280000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 0.00188664

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.14225499999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 5.9743600000000001E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439976
Contaminant: MERCURY

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	7.3972599999999999E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439976
Contaminant:	MERCURY
Amount(Lbs/Yr):	6.6266199999999997E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	3.7732800000000002E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	0.15547069999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	662.66200000000003
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000129000
Contaminant:	PYRENE
Amount(Lbs/Yr):	0.00140865
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	0.59163299999999996
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	21.129750000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	6.8282400000000002E-3

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 3.0584399999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 2.6727399999999998E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 4.3327900000000004E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 0.000440216

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 345.88400000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 138.04769999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 8.1701700000000006

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.31296099999999999

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.35681800000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 0.02366532

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 4.0877200000000002E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.28035700000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 0.69176800000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 1.2396119999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.14086499999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.1070574

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2016
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 23665.32

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 6.1168799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 9.5904199999999995E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 408.77199999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 1.4225500000000001E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 647.97900000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 586.20100000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 487.38200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 881.98099999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 19.11525

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 0.00478941

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 0.00377328

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.305844

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 1.8866400000000001E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056495

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 7.8884400000000003E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 24957

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 6.1168799999999999E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.2394705

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.21663950000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.59163299999999996

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 7.8609999999999999E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439965
Contaminant: MANGANESE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr): 9.6850599999999995E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 7.3249800000000004E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.31296099999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 23898.84

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 21409.080000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 0.00084519

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 6.8282399999999995E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 732.49800000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 790.09699999999998

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 2162.2759999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 19725

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 139.40989999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.30990299999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.13363700000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.24183350000000001

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.33016200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 1.251844

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 1.1214280000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 0.00188664

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.14225499999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 5.9743600000000001E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 7.3972599999999999E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 6.6266199999999997E-2

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2016
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 3.7732800000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.15547069999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 662.66200000000003

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 0.00140865

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 0.59163299999999996

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 21.129750000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 6.8282400000000002E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 3.0584399999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 2.6727399999999998E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 4.3327900000000004E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 0.000440216

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 345.88400000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 138.04769999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 8.1701700000000006

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.31296099999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.35681800000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440484

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: COBALT
Amount(Lbs/Yr): 0.02366532

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 4.0877200000000002E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.28035700000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 0.69176800000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 1.2396119999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.14086499999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.1070574

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 23665.32

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000120127
Contaminant: ANTHRACENE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr): 6.1168799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 9.5904199999999995E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 408.77199999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 1.4225500000000001E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 647.97900000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 586.20100000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 487.38200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 881.98099999999999

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 19.11525

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 0.00478941

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 0.00377328

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.305844

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 1.8866400000000001E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 7.8884400000000003E-4

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 24957

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 6.1168799999999999E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.2394705

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.21663950000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.59163299999999996

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 7.8609999999999999E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 9.6850599999999995E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 7.3249800000000004E-2

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2016
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.31296099999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 23898.84

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 21409.080000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 6.8282399999999995E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 732.49800000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 790.09699999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 0.00084519

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 11.791499999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 21.338249999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 619.80600000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 77.037800000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 124.88630000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 0.00377328

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 0.00676152

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.17294200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440439

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: CADMIUM
Amount(Lbs/Yr): 0.28035700000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.398314

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.39442199999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.36160599999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.30990299999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.59747099999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 5.0973999999999998E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 4.7165999999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.86655800000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 33807600

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 7.8609999999999997E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 330.16199999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 597.471

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 591.63300000000004

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	3.0584399999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	3.0584399999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	0.59747099999999997
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	0.53522700000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	2141.1480000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	1937.0119999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	6.8282400000000002E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	625.92200000000003
Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 560.71400000000006

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 0.02140908

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 8.2507900000000003

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 282.99599999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.17355110000000001

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2016
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 30584400

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 251.55199999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 1.8866400000000001E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.4141199999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 4.0779199999999996E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.188664

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.34141199999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 7.9662799999999996E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 1194.8720000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 27012

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.65437299999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.64797899999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.58620099999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007446095

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	169.03800000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	0.00338076
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	3.0584399999999999E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	2.3898840000000001E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	0.17294200000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.53522700000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	5.6902000000000001E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	0.056346
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439921
Contaminant:	LEAD

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	0.12743499999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	5.0711400000000002E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	7.6460999999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	2.8299599999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	6.7615199999999996E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	0.96733400000000003
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000129000
Contaminant:	PYRENE
Amount(Lbs/Yr):	0.00127435
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	34141200
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000074840
Contaminant:	ETHANE
Amount(Lbs/Yr):	873.36300000000006

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 407.79199999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.3807599999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.4141199999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 3.4141199999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 2.5155199999999998E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.33807599999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 4.5521600000000004E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 0.00450768

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 0.00676152

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 6.1168799999999999E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 7.1363600000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 25538

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 7.3912300000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 3.4141200000000001E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.220108

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.031444

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.1081138

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.17185529999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 8.5353000000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 512.11800000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 458.76600000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.53454800000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.95788200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 654.37300000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 455.21600000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.3807599999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 4.8366700000000004E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 3.3807599999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 4.55938

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 94.331999999999994

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 170.70599999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007446095
Contaminant: SULFUR DIOXIDE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	152.922
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	0.01320648
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	13206.48
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	2.8299599999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	2.8299599999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	5.1211799999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	739.726
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	507.11399999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	18866400

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 535.22699999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 450.76799999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 0.33016200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 361.60599999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 1.8866400000000001E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 11.791499999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 21.338249999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 619.80600000000004

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 77.037800000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 124.88630000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 0.00377328

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 0.00676152

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.17294200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.28035700000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.398314

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.39442199999999999

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2016
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.36160599999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.30990299999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.59747099999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 5.0973999999999998E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 4.7165999999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 407.79199999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.3807599999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.4141199999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 3.4141199999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 2.5155199999999998E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.33807599999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000193395

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 4.58765999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 4.5521600000000004E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.86655800000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 33807600

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 7.8609999999999997E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 330.16199999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 597.471

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 591.63300000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050328
Contaminant: BENZO(A)PYRENE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	3.0584399999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	3.0584399999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	0.59747099999999997
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	0.53522700000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	2141.1480000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	1937.0119999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	6.8282400000000002E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	625.92200000000003
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	560.71400000000006

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 0.02140908

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 8.2507900000000003

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 282.99599999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.17355110000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 30584400

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 251.55199999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 1.8866400000000001E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.4141199999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 4.0779199999999996E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.188664

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.34141199999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 7.9662799999999996E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 1194.8720000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 27012

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.65437299999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.64797899999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.58620099999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 169.03800000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 0.00338076

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 3.0584399999999999E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 2.3898840000000001E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.17294200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.53522700000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 5.6902000000000001E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.056346

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.12743499999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000205992

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 7.6460999999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 6.7615199999999996E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.96733400000000003

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 0.00127435

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 34141200

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 873.36300000000006

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	54.557304646
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	188915.38
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	0NY998100
Contaminant:	UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	10.19317
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	53.746970603
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	0.00083288720965
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	0.00083288720965
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000056495
Contaminant:	3-METHYLCHOLANTHRENE
Amount(Lbs/Yr):	0.0018479826896
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	0.0012493308145
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000057976
Contaminant:	7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr):	0.016426512796

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 1.5544626169

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 2382.52284

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 3200.967

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 1110.5162795

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 0.0018479826896

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 0.01179923547

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 0.0028746397394

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.42338433157

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2012
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 0.024639769195

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 1457.5526169

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 2.359847094

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 1804.5889542

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 1249.3308145

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 0.0024639769195

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 123908400

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 0.0051332852489

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2012
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 0.0012319884597

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 0.0018479826896

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 0.0018479826896

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 0.0031909771493

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 0.0012493308145

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 0.0012493308145

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 86912.08

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.55741376489

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.39062303891

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 0.26703655294

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 1.1293227548

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 2.1566141245

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.20547941795

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 4.517291019

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 0.012407984597

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 1.1297103948

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440473

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: CHROMIUM
Amount(Lbs/Yr): 1.4550808297

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 1148.7377661

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 0.0022655835504

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 113931600

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 0.00471996573

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 0.0011327917752

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 0.0016991876628

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 0.0016991876628

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000206440
Contaminant: FLUORANTHENE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	0.002893561938
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	0.0011487377661
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	0.0011487377661
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	79849.87
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	0.496453623
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	0.35899109548
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439976
Contaminant:	MERCURY
Amount(Lbs/Yr):	0.24549686796
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	1.0383924606
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	1.9827375066

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	0.1888807392
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	4.1535698424
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	0.011376792752
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	1.0386075106
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	1.3314436044
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	0.079295424264
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.8025114741
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	2.1711842358
Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2012
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 27.375879434

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 1124.878

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007446119
Contaminant: SULFUR TRIOXIDE
Amount(Lbs/Yr): 22.287

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 480.8607

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 0.022949085504

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 2093.829

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.76582517743

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 7190.5744096

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2012
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 30.266609133

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 172417.925

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 5.6548375

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 48.802473589

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 0.00076582517743

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 0.00076582517743

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 0.0016991876628

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 0.0011487377661

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 0.015103890336

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 1.3939565605

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 2187.9118

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 2943.233

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 1021.1002366

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 0.0016991876628

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 0.010849190014

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 0.0026431808088

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000091203

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	0.38929446519
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	0.022655835504
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000106978
Contaminant:	BUTANE
Amount(Lbs/Yr):	1340.1940605
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	2.1698380027
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	1659.2878844
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	0.086239192181
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.87286993231
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	2.3613112145
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440666
Contaminant:	ZINC

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	29.773195403
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	627.04812
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007446119
Contaminant:	SULFUR TRIOXIDE
Amount(Lbs/Yr):	0.301302
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	534.1513
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	0.025168369195
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	2280.8164
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	0.83288720965
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	7831.8427783
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	81.900133838282699

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	2.3192316622719198
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000074828
Contaminant:	METHANE
Amount(Lbs/Yr):	2583.991
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	0.68393840356470004
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	3.7077329098688199
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	1956.7171305187901
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	134518897.91999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	96502.540548000004
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	0.55959942886778602
Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2011
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.82080841875767696

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 0.29947866859083

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 2.4031236877058202

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.237759257654787

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 1.3489231851164201E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 812.24250840000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 4.8275508127604803E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 2472.7739999999999

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2011
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 1.3004780870125201

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 8687.3071200824907

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 209559.53279999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 16339.298932142199

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 9.1111687012523601E-5

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 9.2442787012523599E-5

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 2.00749797390597E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 1.4137873051878601E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 0.00178444264347197

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 347.72699999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 120.637449350032

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount(Lbs/Yr): 0.00258479

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 2.0553519222513299E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 0.00138085089934408

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 4.1068135638818999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 2.6766639652079601E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000106978

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: BUTANE
Amount(Lbs/Yr): 158.33665227191599

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount(Lbs/Yr): 8.2047270000000002E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000107028
Contaminant: ACROLEIN
Amount(Lbs/Yr): 0.000311725

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 196.03585519380101

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000115071
Contaminant: PROPYLENE
Amount(Lbs/Yr): 8.6946000000000002E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 2.7396828971838901E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 5.7374690869702104E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 1.3548109648161901E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	2.0201349602653199E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	2.0108379703006999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	3.6022866796847202E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	1.3623943051878601E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	0.122680431738698
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	001330207
Contaminant:	XYLENE, M, O & P MIXT.
Amount(Lbs/Yr):	9.6044999999999995E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	1.3690673051878601E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	0.49072172695479299
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	0.12510231973869801

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.16168889130379799

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 9.3683238782278702E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 9.4798515434448699E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.25651362999909599

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 3.2343022912929502

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 54.963299999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 5.5787649903999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 1.3988808399999999

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2009
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 7.9926399999999995E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 610.86479999999995

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 2.4824200000000001E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075005
Contaminant: PM-10
Amount(Lbs/Yr): 7593.9326000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 279752.04800000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 5495.2455200000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075100
Contaminant: UNSPECIATED PARTICULATES (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 7594.3346000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 7593.6310999999996

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2009
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 507.38920000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 5.4945606817175701E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 278.59458891855701

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 1.1447001420244901E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 2.7472803408587802E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 4.1209205112881703E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 6.9677408521469602E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 2.78594588918557E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 2.78594588918557E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 19357.472000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.118451614202449

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 8.7041450793861497E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 5.9533887385273598E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.251834031245388

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.480830939650287

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 4.5801277680979698E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440393

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: BARIUM
Amount(Lbs/Yr): 1.00733612498155

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 2.7551803408587799E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.25186879124538802

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.32210867976685797

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 1.9230962386011501E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.19461798414416401

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.52656206533126704

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 6.6392734637420601

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007446095
Contaminant: SULFUR DIOXIDE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	227.89879999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007446119
Contaminant:	SULFUR TRIOXIDE
Amount(Lbs/Yr):	3.6023999999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	115.35442
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	5.5419606817175698E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	0.185729725945704
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	1742.56701587723
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	0NY075105
Contaminant:	UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	4.8921702739999997
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	64548.080000000002
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	0NY998100
Contaminant:	UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	0.91403000000000001

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	11.7597878716065
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	1.85729725945704E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	1.85729725945704E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	2.78594588918557E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	0.33371702040498302
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000074828
Contaminant:	METHANE
Amount(Lbs/Yr):	530.27596000000005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000074840
Contaminant:	ETHANE
Amount(Lbs/Yr):	713.7998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000074986
Contaminant:	PROPANE
Amount(Lbs/Yr):	247.63963459427299
Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2009
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 4.1209205112881703E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 2.6311711175641501E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 6.4103207953371602E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 9.4412610689066395E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 5.4945606817175703E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 325.02702040498298

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.526234223512829

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 402.41440621569302

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2009
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 27630960

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 74.955522000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 1.2199999999999999E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.60943879999999995

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000106467
Contaminant: BENZENE, 1,4-DICHLORO-
Amount(Lbs/Yr): 1.198896

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 3.3968720000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 1798.3440000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 83924.729999999996

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.50004652000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.37998808000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 0.25992964000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 2.0982368400000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.20004111999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 1.2158840000000001E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 1.09915684

AIRS Emissions:
County: ONONDAGA
Municipality: SYRACUSE
Facility ID: 7311500204
Facility Name: SYRACUSE UNIVERSITY - STEAM STATION
SIC Code: 8221

Year: 2021
VOC(tons): 4.27
NOx(tons): 48.32
Co(tons): 40.47

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Co2(tons):	57812.4
Particulates:	3.66
PM10(tons):	0.01
PM2.5(tons):	3.64
HAPS:	0.91
So2:	0.29
Year:	2020
VOC(tons):	9.6
NOx(tons):	53.52
Co(tons):	44.38
Co2(tons):	61167.89
Particulates:	3.98
PM10(tons):	0
PM2.5(tons):	3.96
HAPS:	0
So2:	0.42
Year:	2019
VOC(tons):	2.27
NOx(tons):	54.04
Co(tons):	45.11
Co2(tons):	64440.6
Particulates:	0.02
PM10(tons):	0
PM2.5(tons):	4.06
HAPS:	0
So2:	0.32
Year:	2018
VOC(tons):	2.18
NOx(tons):	51.79
Co(tons):	43.33
Co2(tons):	61899
Particulates:	3.92
PM10(tons):	0
PM2.5(tons):	3.9
HAPS:	0
So2:	0.31
Year:	2017
VOC(tons):	9.05
NOx(tons):	58.04
Co(tons):	44.71
Co2(tons):	62430.76
Particulates:	4.24
PM10(tons):	0
PM2.5(tons):	4.22
HAPS:	0
So2:	0.59
Year:	2016
VOC(tons):	3.08
NOx(tons):	48.62
Co(tons):	41.09
Co2(tons):	58699.8
Particulates:	3.74

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

PM10(tons):	0
PM2.5(tons):	3.72
HAPS:	0
So2:	0.29
Year:	2015
VOC(tons):	2.14
NOx(tons):	50.59
Co(tons):	42.44
Co2(tons):	60684.56
Particulates:	3.86
PM10(tons):	0.02
PM2.5(tons):	3.82
HAPS:	0
So2:	0.31
Year:	2014
VOC(tons):	10.13
NOx(tons):	107.69
Co(tons):	48.17
Co2(tons):	79011.04
Particulates:	4.04
PM10(tons):	0
PM2.5(tons):	4.02
HAPS:	0
So2:	0.32
Year:	2013
VOC(tons):	2.85
NOx(tons):	94.46
Co(tons):	43.46
Co2(tons):	61954.2
Particulates:	3.95
PM10(tons):	3.95
PM2.5(tons):	3.92
HAPS:	0
So2:	0.31
Year:	2012
VOC(tons):	2.61
NOx(tons):	86.21
Co(tons):	39.92
Co2(tons):	56965.8
Particulates:	3.63
PM10(tons):	3.61
PM2.5(tons):	3.6
HAPS:	0
So2:	0.56
Year:	2011
VOC(tons):	9.43
NOx(tons):	104.78
Co(tons):	48.25
Co2(tons):	67259.45
Particulates:	4.35
PM10(tons):	4.35
PM2.5(tons):	4.34

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

HAPS:	0
So2:	0.41
Year:	2010
VOC(tons):	3.69
NOx(tons):	139.88
Co(tons):	41.96
Co2(tons):	66358.57
Particulates:	11.39
PM10(tons):	7.6
PM2.5(tons):	3.8
HAPS:	0
So2:	0.31

G51 **SYRACUSE UNIVERSITY STEAM STATION** **UST FINDER** **1028588722**
SE **500 EAST TAYLOR ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.116 mi.
613 ft. **Site 11 of 15 in cluster G**

Relative: **Higher**
Actual: **406 ft.**

UST FINDER:

Object ID:	318218
Facility ID:	NY44931
Name:	SYRACUSE UNIVERSITY STEAM STATION
Address:	500 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY
Address Match Type:	Not reported
Open USTs:	4
Closed USTs:	3
TOS USTs:	0
Population 1500ft:	3032
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Open UST(s)
Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.143772
Y Coord:	43.039411
Latitude:	43.039411
Longitude:	-76.143772

UST FINDER:

Object ID:	1277884
Facility ID:	NY44931
Tank ID:	NY70351

SYRACUSE UNIVERSITY STEAM STATION (Continued) **1028588722**

Tank Status:	Closed
Installation Date:	1963/01/01 16:00:01+00
Removal Date:	Not reported
Tank Capacity:	30000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1277885
Facility ID:	NY44931
Tank ID:	NY70352
Tank Status:	Open
Installation Date:	1989/08/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	30000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1277886
Facility ID:	NY44931
Tank ID:	NY70956
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	Not reported
Tank Capacity:	15000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1277887
Facility ID:	NY44931
Tank ID:	NY71906
Tank Status:	Closed
Installation Date:	1963/01/01 16:00:01+00
Removal Date:	Not reported
Tank Capacity:	30000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1277888
Facility ID:	NY44931
Tank ID:	NY71907
Tank Status:	Open
Installation Date:	1989/08/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	30000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1277889
Facility ID:	NY44931
Tank ID:	NY73477
Tank Status:	Open
Installation Date:	1989/08/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	30000
Substances:	Not reported
Tank Wall Type:	Not reported

SYRACUSE UNIVERSITY STEAM STATION (Continued) **1028588722**

Object ID:	1277890
Facility ID:	NY44931
Tank ID:	NY75588
Tank Status:	Open
Installation Date:	1989/08/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	30000
Substances:	Not reported
Tank Wall Type:	Not reported

G52 **SYRACUSE UNIVERSITY-STEAM STA** **RCRA NonGen / NLR** **1000145092**
SE **500 EAST TAYLOR ST** **E MANIFEST** **NYD982271918**
< 1/8 **SYRACUSE, NY 13244** **NJ MANIFEST**
0.116 mi.
613 ft. **Site 12 of 15 in cluster G**

Relative: **Higher**
Actual: **406 ft.**

RCRA Listings:

Date Form Received by Agency:	20190503
Handler Name:	Syracuse University - Steam Station
Handler Address:	E Taylor St
Handler City,State,Zip:	SYRACUSE, NY 13244
EPA ID:	NYD982271918
Contact Name:	Not reported
Contact Address:	Not reported
Contact City,State,Zip:	Not reported
Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	Not reported
Mailing City,State,Zip:	Not reported
Owner Name:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20190503
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	D002
Waste Description:	Corrosive Waste
Waste Code:	F001
Waste Description:	The Following Spent Halogenated Solvents Used In Degreasing: Tetrachloroethylene, Trichlorethylene, Methylene Chloride, 1,1,1-Trichloroethane, Carbon Tetrachloride And Chlorinated Fluorocarbons; All Spent Solvent Mixtures/Blends Used In Degreasing Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Halogenated Solvents Or Those Solvents Listed In F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code:	F002
Waste Description:	The Following Spent Halogenated Solvents: Tetrachloroethylene, Methylene Chloride, Trichloroethylene, 1,1,1-Trichloroethane, Chlorobenzene, 1,1,2-Trichloro-1,2,2-Trifluoroethane, Ortho-Dichlorobenzene, Trichlorofluoromethane, And 1,1,2, Trichloroethane; All Spent Solvent Mixtures/Blends Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Halogenated Solvents Or Those Solvents Listed In F001, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	SYRACUSE UNIV BD OF TRUSTEES
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	TOLLEY ADMINISTRATION BLDG
Owner/Operator City,State,Zip:	SYRACUSE, NY 13244
Owner/Operator Telephone:	315-443-4132
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name:	SYRACUSE UNIV BD OF TRUSTEES
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	TOLLEY ADMINISTRATION BLDG
Owner/Operator City,State,Zip:	SYRACUSE, NY 13244
Owner/Operator Telephone:	315-443-4132
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	SYRACUSE UNIV BD OF TRUSTEES
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	TOLLEY ADMINISTRATION BLDG
Owner/Operator City,State,Zip:	SYRACUSE, NY 13244
Owner/Operator Telephone:	315-443-4132
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	SYRACUSE UNIVERSITY
Legal Status:	Private
Date Became Current:	19270101
Date Ended Current:	Not reported
Owner/Operator Address:	900 S CROUSE AVE
Owner/Operator City,State,Zip:	SYRACUSE, NY 13244
Owner/Operator Telephone:	315-443-4132
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	315-443-3081
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name:	SYRACUSE UNIVERSITY
Legal Status:	Private
Date Became Current:	19270101
Date Ended Current:	Not reported
Owner/Operator Address:	900 S CROUSE AVE
Owner/Operator City,State,Zip:	SYRACUSE, NY 13244
Owner/Operator Telephone:	315-443-4132

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: 315-443-3081
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20060101
Handler Name: SYRACUSE UNIV - STEAM STATION
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: SYRACUSE UNIV - STEAM STATION
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20190503
Handler Name: SYRACUSE UNIVERSITY - STEAM STATION
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 19870807
Handler Name: SYRACUSE UNIV - STEAM STATION
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Receive Date: 19920228
Handler Name: SYRACUSE UNIVERSITY STEAM STATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20180502
Handler Name: SYRACUSE UNIVERSITY - STEAM STATION
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

List of NAICS Codes and Descriptions:
NAICS Code: 61131
NAICS Description: COLLEGES, UNIVERSITIES, AND PROFESSIONAL SCHOOLS

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

E MANIFEST:
Manifest Tracking Number: 001556606VES
Last Updated Date: 20191226
Shipped Date: 20191206
Received Date: 20191218
Manifest Status: Signed
Submission Type: DataImage5Copy
Origin Type: Service
Generator EPA ID: NYD982271918
Generator Name: Syracuse University-Steam Sta
Generator Mail Street Number: Not reported
Generator Mail Street 1: 500 EAST TAYLOR ST
Generator Mail Street 2: STEAM STATION
Generator Mail City: SYRACUSE
Generator Mail State: NY
Generator Mail Zip: 13244
Generator Location Street Number: Not reported
Generator Location Street 1: C/O EHSS

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Generator Location Street 2:	100 College Place
Generator Location City:	SYRACUSE
Generator Location Zip:	13244
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD002454544
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	125 FACTORY LN
Designated Facility Mail City:	MIDDLESEX
Designated Facility Mail Zip:	08846
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	125 FACTORY LN
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	MIDDLESEX
Designated Facility Location Zip:	08846
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	VEOLIA ES TECHNICAL SOLUTIONS LLC
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	001556943VES
Last Updated Date:	20201211
Shipped Date:	20201120
Received Date:	20201201
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 EAST TAYLOR ST
Generator Mail Street 2:	STEAM STATION
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13244-0000
Generator Location Street Number:	Not reported
Generator Location Street 1:	C/O EHSS
Generator Location Street 2:	100 College Place
Generator Location City:	SYRACUSE
Generator Location Zip:	13244-0000
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD980536593
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	1
Designated Facility Mail Street 1:	1 EDEN LANE
Designated Facility Mail Street 2:	L.L.C.
Designated Facility Mail City:	FLANDERS
Designated Facility Mail Zip:	07836
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	1
Designated Facility Location Street 1:	L.L.C.
Designated Facility Location Street 2:	1 EDEN LANE
Designated Facility Location City:	FLANDERS

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Designated Facility Location Zip:	07836
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	VEOLIA ES TECHNICAL SOLUTIONS
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	001558051VES
Last Updated Date:	20200304
Shipped Date:	20200220
Received Date:	20200228
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 EAST TAYLOR ST
Generator Mail Street 2:	STEAM STATION
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13244
Generator Location Street Number:	Not reported
Generator Location Street 1:	C/O EHSS
Generator Location Street 2:	100 College Place
Generator Location City:	SYRACUSE
Generator Location Zip:	13244
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	OHD093945293
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	4301 INFIRMARY RD PO BOX 453
Designated Facility Mail City:	WEST CARROLLTON
Designated Facility Mail Zip:	45342
Designated Facility Mail State:	OH
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	4301 INFIRMARY RD
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	WEST CARROLLTON
Designated Facility Location Zip:	45449
Designated Facility Location State:	OH
Designated Facility Contact Company Name:	VEOLIA ES TECHNICAL SOLUTIONS LLC
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	001560223VES
Last Updated Date:	20230417
Shipped Date:	20230315
Received Date:	20230324
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 EAST TAYLOR ST

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Generator Mail Street 2:	STEAM STATION
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13244
Generator Location Street Number:	Not reported
Generator Location Street 1:	C/O EHSS
Generator Location Street 2:	100 College Place
Generator Location City:	SYRACUSE
Generator Location Zip:	13244
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD980536593
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	1
Designated Facility Mail Street 1:	1 EDEN LANE
Designated Facility Mail Street 2:	L.L.C.
Designated Facility Mail City:	FLANDERS
Designated Facility Mail Zip:	07836
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	1
Designated Facility Location Street 1:	L.L.C.
Designated Facility Location Street 2:	1 EDEN LANE
Designated Facility Location City:	FLANDERS
Designated Facility Location Zip:	07836
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	VEOLIA ES TECHNICAL SOLUTIONS
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	001563043VES
Last Updated Date:	20190515
Shipped Date:	20190424
Received Date:	20190501
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 EAST TAYLOR ST
Generator Mail Street 2:	STEAM STATION
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13244-0000
Generator Location Street Number:	Not reported
Generator Location Street 1:	C/O EHSS
Generator Location Street 2:	100 College Place
Generator Location City:	SYRACUSE
Generator Location Zip:	13244-0000
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD980536593
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	1
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	1 EDEN LANE
Designated Facility Mail City:	FLANDERS

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Designated Facility Mail Zip:	07836
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	1
Designated Facility Location Street 1:	1 EDEN LANE
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	FLANDERS
Designated Facility Location Zip:	07836
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	VEOLIA ES TECHNICAL SOLUTIONS LLC
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	001563044VES
Last Updated Date:	20190605
Shipped Date:	20190424
Received Date:	20190501
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 EAST TAYLOR ST
Generator Mail Street 2:	STEAM STATION
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13244-0000
Generator Location Street Number:	Not reported
Generator Location Street 1:	C/O EHSS
Generator Location Street 2:	100 College Place
Generator Location City:	SYRACUSE
Generator Location Zip:	13244-0000
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	OHD093945293
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	PO BOX 453
Designated Facility Mail Street 2:	4301 INFIRMARY RD
Designated Facility Mail City:	WEST CARROLLTON
Designated Facility Mail Zip:	45449
Designated Facility Mail State:	OH
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	4301 INFIRMARY RD
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	WEST CARROLLTON
Designated Facility Location Zip:	45449-1278
Designated Facility Location State:	OH
Designated Facility Contact Company Name:	VEOLIA ES TECHNICAL SOLUTIONS LLC
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	001563623VES
Last Updated Date:	20220512
Shipped Date:	20220428
Received Date:	20220504
Manifest Status:	Signed

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 EAST TAYLOR ST
Generator Mail Street 2:	STEAM STATION
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13244
Generator Location Street Number:	Not reported
Generator Location Street 1:	C/O EHSS
Generator Location Street 2:	100 College Place
Generator Location City:	SYRACUSE
Generator Location Zip:	13244
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD980536593
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	1
Designated Facility Mail Street 1:	1 EDEN LANE
Designated Facility Mail Street 2:	L.L.C.
Designated Facility Mail City:	FLANDERS
Designated Facility Mail Zip:	07836
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	1
Designated Facility Location Street 1:	L.L.C.
Designated Facility Location Street 2:	1 EDEN LANE
Designated Facility Location City:	FLANDERS
Designated Facility Location Zip:	07836
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	VEOLIA ES TECHNICAL SOLUTIONS
Manifest Residue Indicator:	N
Rejection Indicator:	N
Manifest Tracking Number:	001563639VES
Last Updated Date:	20220708
Shipped Date:	20220601
Received Date:	20220615
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 EAST TAYLOR ST
Generator Mail Street 2:	STEAM STATION
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13244
Generator Location Street Number:	Not reported
Generator Location Street 1:	C/O EHSS
Generator Location Street 2:	100 College Place
Generator Location City:	SYRACUSE
Generator Location Zip:	13244
Generator Location State:	NY
Generator Contact Company Name:	Not reported

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Designated Facility EPA ID:	NJD980536593
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	1
Designated Facility Mail Street 1:	1 EDEN LANE
Designated Facility Mail Street 2:	L.L.C.
Designated Facility Mail City:	FLANDERS
Designated Facility Mail Zip:	07836
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	1
Designated Facility Location Street 1:	L.L.C.
Designated Facility Location Street 2:	1 EDEN LANE
Designated Facility Location City:	FLANDERS
Designated Facility Location Zip:	07836
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	VEOLIA ES TECHNICAL SOLUTIONS
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	001563659VES
Last Updated Date:	20220926
Shipped Date:	20220824
Received Date:	20220831
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 EAST TAYLOR ST
Generator Mail Street 2:	STEAM STATION
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13244
Generator Location Street Number:	Not reported
Generator Location Street 1:	C/O EHSS
Generator Location Street 2:	100 College Place
Generator Location City:	SYRACUSE
Generator Location Zip:	13244
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD980536593
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	1
Designated Facility Mail Street 1:	1 EDEN LANE
Designated Facility Mail Street 2:	L.L.C.
Designated Facility Mail City:	FLANDERS
Designated Facility Mail Zip:	07836
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	1
Designated Facility Location Street 1:	L.L.C.
Designated Facility Location Street 2:	1 EDEN LANE
Designated Facility Location City:	FLANDERS
Designated Facility Location Zip:	07836
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	VEOLIA ES TECHNICAL SOLUTIONS
Manifest Residue Indicator:	N
Rejection Indicator:	N

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Federal Waste:
- Manifest Tracking Number: 001563659VES
- Waste Line Number: 1
- Federal Waste Code: D008
- Federal Waste: LEAD

State Waste:
- Manifest Tracking Number: 001563659VES
- Waste Line Number: 1
- State Waste Code Owner: NY
- State Waste Code: B
- State Waste: Incineration, heat recovery, burning. Waste management method code to be used on e-Manifest only

Transporter:
- Manifest Tracking Number: 001563659VES
- Transporter Line Number: 1
- Transporter EPA ID: NJD080631369
- Transporter Name: Veolia Es Technical Solutions

- Manifest Tracking Number: 001563659VES
- Transporter Line Number: 2
- Transporter EPA ID: NJD054126164
- Transporter Name: Freehold Cartage Inc

Waste Line:
- Manifest Tracking Number: 001563659VES
- Waste Line Number: 1
- U.S. DOT Hazardous Indicator: Y
- U.S. DOT ID Number: UN2923
- U.S. DOT Description: Un2923, Waste Corrosive Solids, Toxic, N.O.S., (Calcium Hydroxide, Magnesium Hydroxide, Lead), 8 (6.1), Ii, Rq (10-Lbs/D008) **(Stea#18663)
- Non-Hazardous Waste Description: Not reported
- Number of Containers: 1
- Container Type Code: DF
- Container Type Description: Fiberboard or plastic drums, barrels, kegs
- Waste Quantity: 47
- Quantity Unit of Measure Code: P
- Quantity Unit of Measure Description: Pounds
- Waste Quantity, in Tons: 0.0235
- Acute Waste Quantity, in Tons: 0
- Non-Acute Waste Quantity, in Tons: 0.0235
- Waste Quantity, in Kilograms: 21.315205
- Acute Waste Quantity, in Kilograms: 0
- Non-Acute Waste Quantity, in Kilorgrams: 21.315205
- Management Method Code: H141
- Management Method Description: STORAGE, BULKING AND/OR TRANSFER OFF SITE
- Waste Residue Indicator: N
- Quantity Discrepancy Indicator: N
- Waste Type Discrepancy Indicator: N
- Waste Density: Not reported
- Waste Density Unit of Measure Code: Not reported
- Waste Density Unit of Measure Description: Not reported
- Form Code: Not reported

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Form Code Description:	Not reported
Source Code:	Not reported
Source Code Description:	Not reported
Waste Minimization Code:	Not reported
Waste Minimization Code Description:	Not reported
Consent Number:	Not reported
EPA Waste Indicator:	Y

NJ MANIFEST:

EPA ID:	NYD982271918
Name:	SYRACUSE UNIVERSITY STEAM ST
Address:	500 E TAYLOR ST.
City,State,Zip:	SYRACUSE, NY 13244
County:	Not reported
Mailing Address:	500 E TAYLOR ST.
Mailing City,State,Zip:	SYRACUSE 13244
Telephone:	3154434188
Emergency Telephone:	3154434188
Contact:	Not reported
Comments:	Not reported
SIC Code:	Not reported
County:	00
Municipal:	00
Previous EPAID:	Not reported
Generator Flag:	X
Transporter Flag:	Not reported
TSDF Flag:	Not reported
Name Change:	Not reported
Date Change:	000000

Manifest Data:

EPA ID:	NYD982271918
Manifest Number:	NJA3092111
Date Shipped:	07/16/2004
TSDF EPA ID:	NJD980536593
Transporter EPA ID:	NJD080631369
Transporter 2 EPA ID:	NJD054126164
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/16/2004
Date Trans2 Transported Waste:	07/22/2004
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/23/2004
TSDF EPA Facility Name:	Not reported

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	09030422
Was Load Rejected:	N
Reason Load Was Rejected:	Not reported

EPA ID:	NYD982271918
Manifest Number:	000380452VES
Date Shipped:	02/05/2010
TSDF EPA ID:	NJD980536593
Transporter EPA ID:	NJD080631369
Transporter 2 EPA ID:	NJD054126164
Transporter 3 EPA ID:	NJD000692061
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	02/05/2010
Date Trans2 Transported Waste:	02/11/2010
Date Trans3 Transported Waste:	02/16/2010
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	02/16/2010
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	N
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Waste Code:	D009
Hand Code:	H141
Quantity:	1
Unit:	P

EPA ID:	NYD982271918
Manifest Number:	NJA3091700
Date Shipped:	07/08/2005
TSDF EPA ID:	NJD980536593
Transporter EPA ID:	NJD080631369
Transporter 2 EPA ID:	NJD054126164
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/08/2005
Date Trans2 Transported Waste:	07/14/2005
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/15/2005
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	08230521
Was Load Rejected:	N
Reason Load Was Rejected:	Not reported

EPA ID:	NYD982271918
Manifest Number:	000570816VES
Date Shipped:	10/6/2011
TSDF EPA ID:	NJD980536593
Transporter EPA ID:	NJD080631369
Transporter 2 EPA ID:	NJD054126164
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	Not reported
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D009
Hand Code:	H141
Quantity:	17.00
Unit:	Pounds

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H141
Quantity:	124.00
Unit:	Pounds

EPA ID:	NYD982271918
Manifest Number:	NJA3092105
Date Shipped:	03/11/2004
TSDF EPA ID:	NJD002454544
Transporter EPA ID:	NJD080631369
Transporter 2 EPA ID:	NJD054126164
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported

SYRACUSE UNIVERSITY-STEAM STA (Continued) **1000145092**

Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	03/11/2004
Date Trans2 Transported Waste:	03/16/2004
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	03/17/2004
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	04020421
Was Load Rejected:	N
Reason Load Was Rejected:	Not reported

G53 **SYRACUSE UNIV STEAM STATION** **NY Spills** **S117974012**
SE **500 EAST TAYLOR ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.116 mi.
613 ft. **Site 13 of 15 in cluster G**

Relative: **Higher**
Actual: **406 ft.**

SPILLS:

Name:	SYRACUSE UNIV STEAM STATION
Address:	500 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1502394 / 2016-04-08
Facility ID:	1502394
Facility Type:	ER
DER Facility ID:	463342
Site ID:	508657
DEC Region:	7
Spill Cause:	Human Error
Spill Class:	B3
SWIS:	3415
Spill Date:	2015-06-03
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2015-06-03
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	2016-04-08
Cleanup Meets Std:	False

SYRACUSE UNIV STEAM STATION (Continued) **S117974012**

Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2015-06-03
Spill Record Last Update:	2016-04-08
Spiller Name:	BECKY PONZA
Spiller Company:	SYRACUSE UNIV STEAM STATION
Spiller Address:	500 EAST TAYLOR ST
Spiller Company:	999
Contact Name:	BECKY PONZA
Latitude:	43.0391860
Longitude:	-76.1431310
DEC Memo:	NO ACTIVE CBS REGISTRATION AT THIS FACILITY AND MATERIAL SPILLED IS NOT STORED IN BULK AT THIS FACILITY. THEREFORE HAZ SPILL MUNI REPORTING NOT NECESSARY. SOIL AND ASPHALT PARKING LOT CLEANED BY SU PERSONNEL. SMALL AMOUNT OF MATERIAL SPILLED TO GRAVEL ON LOT NEXT DOOR THAT SU EXCAVATED AND DISPOSED OF ALSO. 7/22/2015 - Disposal documentation requested. KCKemp 4/8/2016 - No disposal documentation received. Spill closed as not meeting standards due to lack of disposal documentation. KCKemp
Remarks:	mixture was being pumped out of drum, loss to soil. C/u pending

All Materials:

Site ID:	508657
Operable Unit ID:	1257965
Operable Unit:	01
Material ID:	2261031
Material Code:	0039A
Material Name:	sulfuric acid
Case No.:	07664939
Material FA:	Hazardous Material
Quantity:	15.00
Units:	G
Recovered:	15.00
Resource Affected:	Soil, Impervious Surface
Oxygenate:	Not reported

Site ID:	508657
Operable Unit ID:	1257965
Operable Unit:	01
Material ID:	2261032
Material Code:	0110A
Material Name:	phosphoric acid
Case No.:	07664382
Material FA:	Hazardous Material
Quantity:	15.00
Units:	G
Recovered:	15.00
Resource Affected:	Soil, Impervious Surface
Oxygenate:	Not reported

G54 **SYRACUSE UNIVERSITY STEAM STATION** **NY UST** **U004148320**
SE **500 EAST TAYLOR ST** **NY AST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.116 mi.
613 ft. **Site 14 of 15 in cluster G**

Relative:
Higher

Actual:
406 ft.

UST:

Name:	SYRACUSE UNIVERSITY STEAM STATION
Address:	500 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-180602 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	06/18/2027
UTM X:	406857.02521
UTM Y:	4765814.73916
Site Type:	School

Affiliation Records:

Site Id:	44931
Affiliation Type:	Mail Contact
Company Name:	SYRACUSE UNIVERSITY
Contact Type:	Not reported
Contact Name:	REBECCA J PONZA
Address1:	ENVIRONMENTAL HEALTH & SAFETY SERVICES
Address2:	029 LYMAN HALL, 100 COLLEGE PL
City:	SYRACUSE
State:	NY
Zip Code:	13244-1270
Country Code:	001
Phone:	(315) 443-9133
EMail:	EHSS@SYR.EDU
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2020-10-02

Site Id:	44931
Affiliation Type:	Emergency Contact
Company Name:	SYRACUSE UNIVERSITY
Contact Type:	Not reported
Contact Name:	SU PUBLIC SAFETY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(315) 443-2224
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2013-07-12

Site Id:	44931
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE UNIVERSITY
Contact Type:	DIRECTOR EHSS
Contact Name:	REBECCA J PONZA
Address1:	CROUSE-HINDS HALL - 900 SOUTH CROUSE AVE

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13244-2130
Country Code:	001
Phone:	(315) 443-4132
EMail:	ehss@syr.edu
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2018-12-21

Site Id:	44931
Affiliation Type:	Facility Operator
Company Name:	SYRACUSE UNIVERSITY STEAM STATION
Contact Type:	Not reported
Contact Name:	NATHAN PRIOR - CENTRIO ENERGY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 443-5105
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2022-03-15

Tank Info:

Tank Number:	001
Tank ID:	129267
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	30000
Install Date:	01/01/1963
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Tightness Test Method:	01
Date Test:	08/01/1985
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

I04 - Overfill - Product Level Gauge (A/G)
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Number:	002
Tank ID:	129268
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	30000
Install Date:	01/01/1963
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	01
Date Test:	08/01/1985
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

I04 - Overfill - Product Level Gauge (A/G)
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Number:	003
Tank ID:	129269
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	15000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None

Tank Number: 005
Tank ID: 129270
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 30000
Install Date: 08/01/1989
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

G04 - Tank Secondary Containment - Double-Walled (Underground)
F05 - Pipe External Protection - Jacketed
B09 - Tank External Protection - Urethane
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
J02 - Dispenser - Suction Dispenser
C03 - Pipe Location - Aboveground/Underground Combination
F04 - Pipe External Protection - Fiberglass
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
B02 - Tank External Protection - Original Sacrificial Anode
E04 - Piping Secondary Containment - Double walled UG
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None

Tank Number: 006
Tank ID: 129271
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 30000
Install Date: 08/01/1989
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

G04 - Tank Secondary Containment - Double-Walled (Underground)
F05 - Pipe External Protection - Jacketed
B09 - Tank External Protection - Urethane
C03 - Pipe Location - Aboveground/Underground Combination
F04 - Pipe External Protection - Fiberglass
J02 - Dispenser - Suction Dispenser
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
B02 - Tank External Protection - Original Sacrificial Anode
E04 - Piping Secondary Containment - Double walled UG
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None

Tank Number: 007
Tank ID: 129272
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 30000
Install Date: 08/01/1989
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

G04 - Tank Secondary Containment - Double-Walled (Underground)
F05 - Pipe External Protection - Jacketed
B09 - Tank External Protection - Urethane
J02 - Dispenser - Suction Dispenser
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
F04 - Pipe External Protection - Fiberglass
C03 - Pipe Location - Aboveground/Underground Combination
K01 - Spill Prevention - Catch Basin
I02 - Overfill - High Level Alarm
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

E04 - Piping Secondary Containment - Double walled UG
B02 - Tank External Protection - Original Sacrificial Anode
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None

Tank Number:	008
Tank ID:	129273
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	30000
Install Date:	08/01/1989
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

G04 - Tank Secondary Containment - Double-Walled (Underground)
F05 - Pipe External Protection - Jacketed
B09 - Tank External Protection - Urethane
C03 - Pipe Location - Aboveground/Underground Combination
J02 - Dispenser - Suction Dispenser
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
F04 - Pipe External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
B02 - Tank External Protection - Original Sacrificial Anode
E04 - Piping Secondary Containment - Double walled UG
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None

AST:

Name:	SYRACUSE UNIVERSITY STEAM STATION
Address:	500 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY 13202
Region:	STATE
DEC Region:	7
Site Status:	Active
Facility Id:	7-180602
Program Type:	PBS
UTM X:	406857.02521
UTM Y:	4765814.73916
Expiration Date:	06/18/2027
Site Type:	School

Affiliation Records:

Site Id:	44931

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

Affiliation Type:	Mail Contact
Company Name:	SYRACUSE UNIVERSITY
Contact Type:	Not reported
Contact Name:	REBECCA J PONZA
Address1:	ENVIRONMENTAL HEALTH & SAFETY SERVICES
Address2:	029 LYMAN HALL, 100 COLLEGE PL
City:	SYRACUSE
State:	NY
Zip Code:	13244-1270
Country Code:	001
Phone:	(315) 443-9133
EMail:	EHSS@SYR.EDU
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2020-10-02

Site Id:	44931
Affiliation Type:	Emergency Contact
Company Name:	SYRACUSE UNIVERSITY
Contact Type:	Not reported
Contact Name:	SU PUBLIC SAFETY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(315) 443-2224
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2013-07-12

Site Id:	44931
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE UNIVERSITY
Contact Type:	DIRECTOR EHSS
Contact Name:	REBECCA J PONZA
Address1:	CROUSE-HINDS HALL - 900 SOUTH CROUSE AVE
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13244-2130
Country Code:	001
Phone:	(315) 443-4132
EMail:	ehss@syr.edu
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2018-12-21

Site Id:	44931
Affiliation Type:	Facility Operator
Company Name:	SYRACUSE UNIVERSITY STEAM STATION
Contact Type:	Not reported
Contact Name:	NATHAN PRIOR - CENTRIO ENERGY
Address1:	Not reported
Address2:	Not reported

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 443-5105
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2022-03-15

Tank Info:

Tank Number:	009
Tank Id:	129274
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Equipment Records:

E99 - Piping Secondary Containment - Other
I05 - Overfill - Vent Whistle
I04 - Overfill - Product Level Gauge (A/G)
C01 - Pipe Location - Aboveground
G01 - Tank Secondary Containment - Diking (Aboveground)
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
J02 - Dispenser - Suction Dispenser
L09 - Piping Leak Detection - Exempt Suction Piping
K00 - Spill Prevention - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Location:	Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	06/01/1990
Capacity Gallons:	275
Tightness Test Method:	-
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	02/25/2019
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	#2 fuel oil (on-site consumption)

Tank Number:	010
Tank Id:	214870
Material Code:	0012
Common Name of Substance:	Kerosene [#1 Fuel Oil] (On-Site Consumption)

Equipment Records:

C01 - Pipe Location - Aboveground
L00 - Piping Leak Detection - None

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

D00 - Pipe Type - No Piping
J02 - Dispenser - Suction Dispenser
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
K01 - Spill Prevention - Catch Basin
E00 - Piping Secondary Containment - None
F00 - Pipe External Protection - None
I01 - Overfill - Float Vent Valve
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating

Tank Location:	Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	12/08/2006
Capacity Gallons:	300
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	10/22/2009
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	kerosene [#1 fuel oil] (on-site consumption)

55
NNW
< 1/8
0.125 mi.
658 ft.

ONONDAGA CO CONVENTION CENTER
S STATE ST
SYRACUSE, NY 13202

RCRA NonGen / NLR **1000458352**
NY MANIFEST **NYD986937431**

Relative:
Lower

Actual:
395 ft.

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	Onondaga Co Convention Center
Handler Address:	S State St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYD986937431
Contact Name:	Not reported
Contact Address:	MONTGOMERY
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	MONTGOMERY
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	County Of Onondaga
Owner Type:	Municipal

ONONDAGA CO CONVENTION CENTER (Continued) **1000458352**

Operator Name:	County Of Onondaga
Operator Type:	Municipal
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name: COUNTY OF ONONDAGA	
Legal Status:	Municipal
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999

ONDONDAGA CO CONVENTION CENTER (Continued) **1000458352**

Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COUNTY OF ONONDAGA
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COUNTY OF ONONDAGA
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 19990708
Handler Name: ONONDAGA CO CONVENTION CENTER
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: ONONDAGA CO CONVENTION CENTER
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101

ONONDAGA CO CONVENTION CENTER (Continued) **1000458352**

Handler Name: ONONDAGA CO CONVENTION CENTER
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19910123
Handler Name: ONONDAGA CO CONVENTION CENTER
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920302
Handler Name: ONONDAGA CITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 23332
NAICS Description: COMMERCIAL AND INSTITUTIONAL BUILDING CONSTRUCTION

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

NY MANIFEST:
EPA ID: NYD986937431
Country: USA
Name: ONONDAGA COUNTY CONVENTION CENTER
Address: 800 SOUTH STATE STREET
Address 2: Not reported

ONONDAGA CO CONVENTION CENTER (Continued) **1000458352**

City,State,Zip: SYRACUSE, NY 13202-0000
Zip 4: Not reported
Location Address 1: SOUTH STATE STREET
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: ONONDAGA COUNTY CONVENTION CENTER
Mailing Contact: T L HEINMILLER
Mailing Address 1: SOUTH STATE STREET
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154352630

Manifest Data:
Document ID: NYB1734435
Manifest Status: Not reported
Trans1 State ID: NYPB2740
Year: 1991
Trans2 State ID: Not reported
Generator Ship Date: 02/19/1991
Trans1 Recv Date: 02/19/1991
Trans2 Recv Date: Not reported
TSD Site Recv Date: 02/22/1991
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986937431
Trans1 EPA ID: NYD980761191
Trans2 EPA ID: Not reported
TSDF ID 1: NYD043815703
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: IGNITABLE WASTE
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00715
Units: Gallons (liquids only)

ONONDAGA CO CONVENTION CENTER (Continued) **1000458352**

Number of Containers: 013
Container Type: Metal drums, barrels, kegs
Handling Method: Treat
Specific Gravity: 01.00

Document ID: NYB1734840
Manifest Status: Not reported
Trans1 State ID: NYPB2740
Year: 1991
Trans2 State ID: Not reported
Generator Ship Date: 04/03/1991
Trans1 Recv Date: 04/03/1991
Trans2 Recv Date: Not reported
TSD Site Recv Date: 04/04/1991
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986937431
Trans1 EPA ID: NYD980761191
Trans2 EPA ID: Not reported
TSDF ID 1: NYD043815703
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: LEAD
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00165
Units: Gallons (liquids only)
Number of Containers: 003
Container Type: Metal drums, barrels, kegs
Handling Method: Landfill
Specific Gravity: 01.00

Document ID: NYB1734165
Manifest Status: Not reported
Trans1 State ID: LH4202
Year: 1991
Trans2 State ID: Not reported
Generator Ship Date: 03/19/1991
Trans1 Recv Date: 03/19/1991
Trans2 Recv Date: Not reported
TSD Site Recv Date: 03/20/1991
Part A Recv Date: Not reported
Part B Recv Date: Not reported

ONONDAGA CO CONVENTION CENTER (Continued) **1000458352**

Generator EPA ID:	NYD986937431
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD043815703
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	01000
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Treat
Specific Gravity:	01.00

Document ID:	NYB4479399
Manifest Status:	Not reported
Trans1 State ID:	HC6160NY
Year:	1992
Trans2 State ID:	Not reported
Generator Ship Date:	02/27/1992
Trans1 Recv Date:	03/02/1992
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	03/02/1992
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986937431
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported

ONONDAGA CO CONVENTION CENTER (Continued) **1000458352**

MGMT Method Type Code:	Not reported
Waste Code 1:	LEAD
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00275
Units:	Gallons (liquids only)
Number of Containers:	005
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

J56 **SYRACUSE HOUSING AUTHORITY** **RCRA-LQG** **1000889954**
SSE **409 BURT STREET** **FINDS** **NY0000201889**
1/8-1/4 **SYRACUSE, NY 13202** **ECHO**
0.125 mi. **NY MANIFEST**
662 ft. **Site 1 of 2 in cluster J**

Relative: **Higher**
Actual: **399 ft.**

RCRA Listings:

Date Form Received by Agency:	20100309
Handler Name:	Syracuse Housing Authority
Handler Address:	Burt St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NY0000201889
Contact Name:	WILLIAM W GEHRKE
Contact Address:	Not reported
Contact City,State,Zip:	Not reported
Contact Telephone:	315-475-6181 x4318
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Federal
Federal Waste Generator Description:	Large Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	2009
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	BURT ST
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Syracuse Housing Authority
Owner Type:	Federal
Operator Name:	Syracuse Housing Authority
Operator Type:	Federal
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	The land is federally-owned, The site is federally-owned, The site is federally-operated
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20210917
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Biennial: List of Years
Year: 2009

Click Here for Biennial Reporting System Data:

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	D002
Waste Description:	Corrosive Waste
Waste Code:	F003
Waste Description:	The Following Spent Nonhalogenated Solvents: Xylene, Acetone, Ethyl Acetate, Ethyl Benzene, Ethyl Ether, Methyl Isobutyl Ketone, N-Butyl Alcohol, Cyclohexanone, And Methanol; All Spent Solvent Mixtures/Blends Containing, Before Use, Only The Above Spent Nonhalogenated Solvents; And All Spent Solvent Mixtures/Blends Containing, Before Use, One Or More Of The Above Nonhalogenated Solvents, And A Total Of Ten Percent Or More (By Volume) Of One Or More Of Those Solvents Listed In F001, F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Waste Code: U213
Waste Description: Furan, Tetrahydro-(I) (Or) Tetrahydrofuran (I)

Handler - Owner Operator:
Owner/Operator Indicator: Owner
Owner/Operator Name: SEYMOUR ROTH EL-ROH
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, NY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SEYMOUR ROTH EL-ROH
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, NY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY
Legal Status: Other
Date Became Current: 19400115
Date Ended Current: Not reported
Owner/Operator Address: 516 BURT ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SEYMOUR ROTH EL-ROH
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, NY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY
Legal Status: Other
Date Became Current: 19400115
Date Ended Current: Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY
Legal Status: Federal
Date Became Current: 19400204
Date Ended Current: Not reported
Owner/Operator Address: 409 BURT ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY
Legal Status: Federal
Date Became Current: 19400204
Date Ended Current: Not reported
Owner/Operator Address: 409 BURT ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20100309
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: Not reported
Recognized Trader Exporter: Not reported
Spent Lead Acid Battery Importer: Not reported
Spent Lead Acid Battery Exporter: Not reported
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 19990708
Handler Name: SYRACUSE HOUSING AUTH
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Receive Date: 20060101
Handler Name: SYRACUSE HOUSING AUTH
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: SYRACUSE HOUSING AUTH
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19940406
Handler Name: SYRACUSE HOUSING AUTH
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20090618
Handler Name: SYRACUSE HOUSING AUTH
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 92511
NAICS Description: ADMINISTRATION OF HOUSING PROGRAMS

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110004313706

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
All generators and treatment, storage, and disposal (TSD) facilities who handle hazardous waste are required to report to the EPA Administrator at least once every two years. The data collected is used to create the National Biennial Resource Conservation and Recovery Act (RCRA) Hazardous Waste Report. This data is processed within the RCRA Information (RCRAInfo) database
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1000889954
Registry ID:	110004313706
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110004313706
Name:	SYRACUSE HOUSING AUTHORITY
Address:	409 BURT STREET
City,State,Zip:	SYRACUSE, NY 13202

NY MANIFEST:

EPA ID:	NY0000201889
Country:	USA
Name:	SYRACUSE HOUSING AUTHORITY
Address:	409 BURT STREET
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	409 BURT STREET
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	SYRACUSE HOUSING AUTHORITY
Mailing Contact:	DAVID LESSUN
Mailing Address 1:	409 BURT ST

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154756181

Manifest Data:
Document ID: NJA1848024
Manifest Status: Not reported
Trans1 State ID: NYLW1771
Year: 1994
Trans2 State ID: 08690
Generator Ship Date: 09/28/1994
Trans1 Recv Date: 09/28/1994
Trans2 Recv Date: 09/29/1994
TSD Site Recv Date: 09/30/1994
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NY0000201889
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: ILD984908202
TSDF ID 1: NJD002182897
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00556
Units: Pounds
Number of Containers: 002
Container Type: Metal drums, barrels, kegs
Handling Method: Burn
Specific Gravity: 01.00

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980253
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	12/23/2009
Trans1 Recv Date:	12/23/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/05/2010
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000201889
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	000634453JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	MERCURY
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	300
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980253
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	12/23/2009
Trans1 Recv Date:	12/23/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/05/2010
Part A Recv Date:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Part B Recv Date: Not reported
Generator EPA ID: NY0000201889
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: PAD067098822
TSDF ID 2: Not reported
Manifest Tracking Number: 000634453JJK
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H141
Waste Code a: MERCURY
Waste Code b: Not reported
Waste Code c: Not reported
Waste Code e: Not reported
Waste Code f: Not reported
Waste Code g: Not reported
Waste Code 1: Not reported
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 200
Units: Pounds
Number of Containers: 1
Container Type: Metal drums, barrels, kegs
Handling Method: Landfill
Specific Gravity: 1

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NYR000115733
Year: 2018
Trans2 State ID: Not reported
Generator Ship Date: 07/10/2009
Trans1 Recv Date: 07/10/2009
Trans2 Recv Date: Not reported
TSD Site Recv Date: 07/17/2009
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NY0000201889
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: PAD067098822
TSDF ID 2: Not reported
Manifest Tracking Number: 002474219FLE
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	IGNITABLE WASTE
Waste Code b:	FURAN, TETRAHYDRO-(I) (OR) TETRAHYDROFURAN (I)
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1100
Units:	Pounds
Number of Containers:	1
Container Type:	Wooden boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	07/10/2009
Trans1 Recv Date:	07/10/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/17/2009
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000201889
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	002474219FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	IGNITABLE WASTE
Waste Code b:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1000
Units:	Pounds
Number of Containers:	1
Container Type:	Wooden boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	07/10/2009
Trans1 Recv Date:	07/10/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/17/2009
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000201889
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	002474219FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	IGNITABLE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Quantity:	1100
Units:	Pounds
Number of Containers:	1
Container Type:	Wooden boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	07/10/2009
Trans1 Recv Date:	07/10/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/17/2009
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000201889
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	002474219FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	IGNITABLE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1200
Units:	Pounds
Number of Containers:	1
Container Type:	Wooden boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Year:	2018
Trans2 State ID:	NJ0000027193
Generator Ship Date:	07/10/2009
Trans1 Recv Date:	07/10/2009
Trans2 Recv Date:	07/17/2009
TSD Site Recv Date:	07/20/2009
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000201889
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	002474221FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	B003
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	3
Units:	Kilograms
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1

J57 **MCKINNEY PROPERTY** **NY ENG CONTROLS** **S108984459**
SE **1226 SOUTH MCBRIDE STREET** **NY INST CONTROL** **N/A**
1/8-1/4 **SYRACUSE, NY 13202** **NY ERP**
0.130 mi. **NY Spills**
689 ft. **Site 2 of 2 in cluster J**

Relative: **Higher**
Actual: **408 ft.**

ENG CONTROLS:

Name:	MCKINNEY PROPERTY
Address:	1226 SOUTH MCBRIDE STREET
City,State,Zip:	SYRACUSE, NY 13202-
Site Code:	57334
HW Code:	E734086
Control Code:	15

MCKINNEY PROPERTY (Continued) **S108984459**

Control Type: ENG
Date Record Added: 12/04/2015
Date Rec Updated: 10/27/2022
Updated By: GWPRISCO
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."
Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a

MCKINNEY PROPERTY (Continued) **S108984459**

Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at

MCKINNEY PROPERTY (Continued) **S108984459**

	0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."
Health Problem:	"People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	False
Record Add:	2004-01-22 11:57:00
Record Upd:	2012-10-04 14:39:00
Updated By:	ldennist
Own Op:	1
Sub Type:	C01
Owner Name:	William Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	C01
Owner Name:	Melissa Liquori
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	E734086
Waste Type:	BENZENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	CHROMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BENZO[K]FLUORANTHENE

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	Petroleum Products
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	TRICHLOROETHENE (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BENZO(B)FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	Chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	ACENAPHTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BARIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	DIBENZ[A,H]ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	LEAD
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	indeno(1,2,3-cd)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	ZINC
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	NAPHTHALENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	XYLENE (MIXED)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	ARSENIC
Waste Quantity:	UNKNOWN

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

INST CONTROL:
Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Control Name: IC/EC Plan
HW Code: E734086
Control Code: 34
Control Type: INST
Dt record added: 12/04/2015
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57334
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South

MCKINNEY PROPERTY (Continued) **S108984459**

McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site,

MCKINNEY PROPERTY (Continued) **S108984459**

though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and

MCKINNEY PROPERTY (Continued) **S108984459**

demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: False
Record Add: 2004-01-22 11:57:00
Record Upd: 2012-10-04 14:39:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: William Simmons
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Melissa Liquori
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: E734086
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported

MCKINNEY PROPERTY (Continued) **S108984459**

HW Code: E734086
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ACENAPHTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ZINC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: XYLENE (MIXED)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Control Name: Monitoring Plan
HW Code: E734086
Control Code: 31
Control Type: INST
Dt record added: 12/04/2015
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57334
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land

MCKINNEY PROPERTY (Continued) **S108984459**

Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and,

MCKINNEY PROPERTY (Continued) **S108984459**

to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site

MCKINNEY PROPERTY (Continued) **S108984459**

contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: False
Record Add: 2004-01-22 11:57:00
Record Upd: 2012-10-04 14:39:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: William Simmons
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Melissa Liquori
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: E734086
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Code: Not reported
HW Code: E734086
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ACENAPHTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ZINC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: XYLENE (MIXED)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported

MCKINNEY PROPERTY (Continued) **S108984459**

HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Control Name: Landuse Restriction
HW Code: E734086
Control Code: 25
Control Type: INST
Dt record added: 12/04/2015
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57334
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad

MCKINNEY PROPERTY (Continued) **S108984459**

line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its

MCKINNEY PROPERTY (Continued) **S108984459**

soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False

MCKINNEY PROPERTY (Continued) **S108984459**

Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: False
Record Add: 2004-01-22 11:57:00
Record Upd: 2012-10-04 14:39:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: William Simmons
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Melissa Liquori
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: E734086
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ACENAPHTHENE

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ZINC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: XYLENE (MIXED)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Control Name: Ground Water Use Restriction
HW Code: E734086
Control Code: 08
Control Type: INST
Dt record added: 12/04/2015
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57334
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA,

MCKINNEY PROPERTY (Continued) **S108984459**

with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm.

MCKINNEY PROPERTY (Continued) **S108984459**

PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported

MCKINNEY PROPERTY (Continued) **S108984459**

Dell:	False
Record Add:	2004-01-22 11:57:00
Record Upd:	2012-10-04 14:39:00
Updated By:	ldennist
Own Op:	1
Sub Type:	C01
Owner Name:	William Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	C01
Owner Name:	Melissa Liquori
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	E734086
Waste Type:	BENZENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	CHROMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BENZO[K]FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	Petroleum Products
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	TRICHLOROETHENE (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BENZO(B)FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	Chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	ACENAPHTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BARIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Type: METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ZINC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: XYLENE (MIXED)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Control Name: Soil Management Plan
HW Code: E734086
Control Code: 14
Control Type: INST
Dt record added: 12/04/2015
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57334
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks,

MCKINNEY PROPERTY (Continued) **S108984459**

capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system

MCKINNEY PROPERTY (Continued) **S108984459**

range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: False
Record Add: 2004-01-22 11:57:00
Record Upd: 2012-10-04 14:39:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: William Simmons

MCKINNEY PROPERTY (Continued) **S108984459**

Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Melissa Liquori
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: E734086
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ACENAPHTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported

MCKINNEY PROPERTY (Continued) **S108984459**

HW Code: E734086
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ZINC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: XYLENE (MIXED)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00

MCKINNEY PROPERTY (Continued) **S108984459**

Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Control Name: Site Management Plan
HW Code: E734086
Control Code: 32
Control Type: INST
Dt record added: 12/04/2015
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57334
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick.

MCKINNEY PROPERTY (Continued) **S108984459**

The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater -

MCKINNEY PROPERTY (Continued) **S108984459**

Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: False
Record Add: 2004-01-22 11:57:00
Record Upd: 2012-10-04 14:39:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: William Simmons
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01

MCKINNEY PROPERTY (Continued) **S108984459**

Owner Name: Melissa Liquori
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: E734086
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ACENAPHTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Code: Not reported
HW Code: E734086
Waste Type: ZINC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: XYLENE (MIXED)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

MCKINNEY PROPERTY (Continued) **S108984459**

Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Control Name: Environmental Easement
HW Code: E734086
Control Code: J
Control Type: INST
Dt record added: 12/04/2015
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57334
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to

MCKINNEY PROPERTY (Continued) **S108984459**

9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an

MCKINNEY PROPERTY (Continued) **S108984459**

IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: False
Record Add: 2004-01-22 11:57:00
Record Upd: 2012-10-04 14:39:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: William Simmons
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Melissa Liquori
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: E734086
Waste Type: BENZENE

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ACENAPHTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ZINC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Code: Not reported
HW Code: E734086
Waste Type: XYLENE (MIXED)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

ERP:
Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Program: ERP
HW Code: E734086

MCKINNEY PROPERTY (Continued) **S108984459**

Site Class:	C
Class N:	C
SWIS:	3415
Region:	7
Town:	Syracuse (c)
Acres:	0.600
Record Added:	01/22/2004
Record Updated:	02/13/2024
Updated By:	GWPRISCO
Site Description:	"Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

MCKINNEY PROPERTY (Continued) **S108984459**

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to

MCKINNEY PROPERTY (Continued) **S108984459**

groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

SPILLS:

Name:	FORMER SCRAP METAL FACILI
Address:	1226 SOUTH MCBRIDE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0712291 / 2009-02-10
Facility ID:	0712291
Facility Type:	ER
DER Facility ID:	168092
Site ID:	393888
DEC Region:	7
Spill Cause:	Other
Spill Class:	C3
SWIS:	3415
Spill Date:	2008-02-21
Investigator:	menash
Referred To:	Not reported
Reported to Dept:	2008-02-21
CID:	406
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2008-02-21
Spill Record Last Update:	2009-02-10
Spiller Name:	SYRACUSE HOUSING AUTHORIT
Spiller Company:	FORMER SCRAP METAL FACILI
Spiller Address:	1226 SOUTH MCBRIDE

MCKINNEY PROPERTY (Continued) **S108984459**

Spiller Company:	001
Contact Name:	SYRACUSE HOUSING AUTHORIT
Latitude:	43.0387182
Longitude:	-76.1438921
DEC Memo:	Spill turned over to Enviromental Remediation(Haz Waste) ERP Site E734086. Claudia Boutot Project Manager.
Remarks:	Gauging existing monitoring wells at the site found free product in one of the wells... #MW3 northwest corner of the site. Dvirka & Bartilucci are doing the investigations and the remediation.

All Materials:

Site ID:	393888
Operable Unit ID:	1150838
Operable Unit:	01
Material ID:	2141481
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	PRIVATE RESIDENCE
Address:	1226 SOUTH MCBRIDE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0402274 / 2004-06-04
Facility ID:	0402274
Facility Type:	ER
DER Facility ID:	168092
Site ID:	202067
DEC Region:	7
Spill Cause:	Other
Spill Class:	E6
SWIS:	3415
Spill Date:	2004-05-31
Investigator:	CXROSSI
Referred To:	Not reported
Reported to Dept:	2004-06-01
CID:	444
Water Affected:	Not reported
Spill Source:	Private Dwelling
Spill Notifier:	Fire Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-06-01
Spill Record Last Update:	2004-06-04
Spiller Name:	JOE GALLAWAY
Spiller Company:	PRIVATE RESIDENCE
Spiller Address:	1226 SOUTH MCBRIDE

MCKINNEY PROPERTY (Continued) **S108984459**

Spiller Company:	001
Contact Name:	JOE GALLAWAY
Latitude:	43.0387069
Longitude:	-76.1438841
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CTR
Remarks:	A FIRE AT THIS RESIDENCE YESTERDAY, NEED DEC TO RESPOND, TO TALK ABOUT CONTAMINATION AND DEBRIS: ON SCENE RIGHT NOW: FD Called Hotline to get response on if there was a record of contamination.

G58 **MC BRIDE SUB** **RCRA NonGen / NLR** **1000164721**
SE **S MCBRIDE** **NY MANIFEST** **NYD980782775**
1/8-1/4 **SYRACUSE, NY 13202**
0.137 mi.
723 ft. **Site 15 of 15 in cluster G**

Relative: **Higher**

Actual: **409 ft.**

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	Mc Bride Sub
Handler Address:	S Mcbride
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYD980782775
Contact Name:	Not reported
Contact Address:	ERIE BLVD W
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	ERIE BLVD W
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Ownername
Owner Type:	Private
Operator Name:	Ownername
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported

MC BRIDE SUB (Continued) **1000164721**

Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	X002
Waste Description:	Not Defined

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: OWNERNAME	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name: OWNERNAME	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported

MC BRIDE SUB (Continued) **1000164721**

Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: OWNERNAME
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 19990708
Handler Name: MC BRIDE SUB
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: MC BRIDE SUB
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: MC BRIDE SUB
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19841120
Handler Name: MC BRIDE SUB

MC BRIDE SUB (Continued) **1000164721**

Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Codes:	No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

NY MANIFEST:

EPA ID:	NYD980782775
Country:	USA
Name:	NIAGARA MOHAWK POWER CORPORATION
Address:	S MCBRIDE
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	MC BRIDE SUBSTATION
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	NIAGARA MOHAWK POWER CORPORATION
Mailing Contact:	NIAGARA MOHAWK POWER CORPORATION
Mailing Address 1:	300 ERIE BLVD WEST
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154282351

Manifest Data:

Document ID:	NYA3713005
Manifest Status:	C - Completed copy
Trans1 State ID:	35218GN
Year:	1986
Trans2 State ID:	7A-010
Generator Ship Date:	860617
Trans1 Recv Date:	860617

MC BRIDE SUB (Continued) **1000164721**

Trans2 Recv Date:	Not reported
TSD Site Recv Date:	860617
Part A Recv Date:	860625
Part B Recv Date:	860625
Generator EPA ID:	NYD980782775
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD980647952
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B003
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	02400
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Recycle
Specific Gravity:	100

Document ID:	NYB1741680
Manifest Status:	Not reported
Trans1 State ID:	CR6700(NY
Year:	1990
Trans2 State ID:	Not reported
Generator Ship Date:	08/28/1990
Trans1 Recv Date:	08/28/1990
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/28/1990
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980782775
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD980647952
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported

MC BRIDE SUB (Continued) **1000164721**

Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B002
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00538
Units:	Kilograms
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	00.89

Document ID:	NYB1741770
Manifest Status:	Not reported
Trans1 State ID:	980C50OH
Year:	1990
Trans2 State ID:	Not reported
Generator Ship Date:	12/04/1990
Trans1 Recv Date:	12/04/1990
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/05/1990
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980782775
Trans1 EPA ID:	OHD981954571
Trans2 EPA ID:	Not reported
TSDF ID 1:	OHD981100969
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B002
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	05381
Units:	Kilograms
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Treat

MC BRIDE SUB (Continued) **1000164721**

Specific Gravity: 00.89

K59 **CENTRAL VILLAGE HOUSING PROJECT** **NY UST** **U000388734**
South **302 BURT ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.142 mi.
752 ft. **Site 1 of 3 in cluster K**

Relative:
Lower

Actual:
396 ft.

UST:

Name:	CENTRAL VILLAGE HOUSING PROJECT
Address:	302 BURT ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-498955 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	02/10/2025
UTM X:	406652.97099
UTM Y:	4765681.72010
Site Type:	Apartment Building/Office Building

Affiliation Records:

Site Id:	46337
Affiliation Type:	Mail Contact
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	MARTY BRUNET
Address1:	516 BURT ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 470-4354
EMail:	MBRUNET@SYRHOUSING.ORG
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2015-01-20

Site Id:	46337
Affiliation Type:	Facility Operator
Company Name:	CENTRAL VILLAGE HOUSING PROJECT
Contact Type:	Not reported
Contact Name:	SYRACUSE HOUSING AUTHORITY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 475-6181
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	46337

CENTRAL VILLAGE HOUSING PROJECT (Continued) **U000388734**

Affiliation Type:	Emergency Contact
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	MARTY BRUNET
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(315) 470-4354
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2015-01-20

Site Id:	46337
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	FACILITIES MANAGER
Contact Name:	MARTIN BRUNET
Address1:	516 BURT ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 470-4354
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2019-12-10

Tank Info:

Tank Number:	001
Tank ID:	133571
Tank Status:	Temporarily Out of Service
Material Name:	Temporarily Out of Service
Capacity Gallons:	10000
Install Date:	12/01/1984
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Fiberglass coated steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Tightness Test Method:	34
Date Test:	07/26/2019
Next Test Date:	07/26/2020
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

A00 - Tank Internal Protection - None

CENTRAL VILLAGE HOUSING PROJECT (Continued) **U000388734**

D01 - Pipe Type - Steel/Carbon Steel/Iron
K00 - Spill Prevention - None
B04 - Tank External Protection - Fiberglass
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None

K60 **CENTRAL VILLAGE HOUSING PROJECT** **UST FINDER** **1028590168**
South **302 BURT ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.142 mi.
752 ft. **Site 2 of 3 in cluster K**

Relative: **Lower**

Actual: **396 ft.**

UST FINDER:

Object ID:	318193
Facility ID:	NY46337
Name:	CENTRAL VILLAGE HOUSING PROJECT
Address:	302 BURT ST
City,State,Zip:	SYRACUSE, NY 13202
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	0
TOS USTs:	1
Population 1500ft:	2207
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Open UST(s)
Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.147216
Y Coord:	43.03821
Latitude:	43.03821
Longitude:	-76.147216

UST FINDER:

Object ID:	1282797
Facility ID:	NY46337
Tank ID:	NY74450
Tank Status:	Temporarily out of Service
Installation Date:	1984/12/01 16:00:00+00

CENTRAL VILLAGE HOUSING PROJECT (Continued) **1028590168**

Removal Date:	Not reported
Tank Capacity:	10000
Substances:	Not reported
Tank Wall Type:	Not reported

K61 **EAST ADAMS REDEVELOPMENT - ALMUS OLVER TOWER** **NY BROWNFIELDS** **S131541419**
South **300 BURT STREET** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.143 mi.
754 ft. **Site 3 of 3 in cluster K**

Relative: **Lower**

Actual: **396 ft.**

BROWNFIELDS:

Name:	EAST ADAMS REDEVELOPMENT - ALMUS OLVER TOWER
Address:	300 BURT STREET
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	657340
Acres:	2.306
HW Code:	C734161
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	09/22/2023
Record Updated Date:	02/14/2024
Update By:	GWPRISCO
Site Description:	"02/13/2024 Site was denied from the Brownfield Cleanup Program (BCP). Based upon review of the BCP application, the proposed site is not a brownfield site as defined in Article 27, Title 14 of the Environmental Conservation Law. Location: The site is located at 300 Burt Street within an urban, mixed-use area in the City of Syracuse, New York. The site is located in the northwestern portion of an about 8.82-acre tax parcel, identified as Onondaga County Tax Parcel 094.-17-01.0. The site is bound by a residential building at 302 Burt Street and Burt Street followed by vacant land at 516 Burt Street to the north, Oakwood Avenue followed by residential and commercial properties at 221-223 Oakwood Avenue and 233-235 Oakwood Avenue, respectively, and vacant land at 229 Oakwood Avenue to the east, residential buildings at 313 Raynor Avenue East and Oakwood Avenue to the south, and vacant land at 234-238 Burt Street and State Street South and 1208, 1210, 1212, 1214, 1216, 1218-1220, and 1224 State Street South to the west. The site is improved with a 12-story apartment building in the central part of the site and asphalt-paved parking lots surrounding the building to the northeast, south, and west. The remainder of the site is comprised of landscaped areas and concrete-paved walkways. The area surrounding the site consists of residential, commercial, and industrial properties. Site Features: According to the May 2023 Phase I Environmental Site Assessment (ESA) and the July 2023 Phase II ESA prepared by EA engineering, P.C. and its affiliate EA Science and Technology (EA), the elevation of the site ranges from about elevation (el) 388 to 398 feet. The topography of the site is generally flat with the surrounding area gently sloping towards the southwest. Current Zoning and Land Use: According to the Rezone Syracuse ordinance and City of Syracuse Zoning Map, the site is located within an MX-4: Urban Core District. The MX-4: Urban Core zoning district is generally characterized as pedestrian-friendly, transit-supportive areas of higher density residential development and a well-integrated mix of non-residential uses. The surrounding properties are zoned for MX-2: Neighborhood

EAST ADAMS REDEVELOPMENT - ALMUS OLVER TOWER (Continued) **S131541419**

Center Districts, R2: Low Density Residential Districts, R4: Medium Density Residential Districts, and R5: High Density Residential Districts. Land use within a half-mile radius is urban and includes residential, commercial, institutional/public services, industrial, vacant land, and public parks. The nearest ecological receptor is the Onondaga Creek, located approximately 0.4 miles west of the site. At present, the site is occupied by a residential building, asphalt-paved parking lots, landscaped areas and concrete-paved walkways. Past Use of the Site: Historical Sanborn Fire Insurance Maps indicate that the site has been located in a residential and commercial area since as early as 1892. By 1892, the site was developed with several one- to two-story dwellings, stables, sheds, and store fronts. By 1910, some of the structures were demolished. From 1951 to 1961, the site was developed with an automobile repair facility in the northwestern part of the site and a printing, paper ruling and book binding facility and a beer warehouse in the southern part of the site. The remainder of the site was developed with residential and commercial buildings, with automobile garages identified in the eastern part of the site. By 1963, the site was occupied by the Syracuse Housing Authority and developed in its present-day configuration. Site Geology and Hydrogeology: According to the U.S. Department of Agriculture s (USDA) Natural Resources Conservation Service (NRCS) Soil Survey Geographic (SSURGO) data for the site, soils at the site are comprised primarily of urban land. Urban land is described as excavated, filled, and made land. According to the Phase II ESA conducted by EA, soil at the site consists of brown silty sand with varying amounts of medium-grained sand, gravel, and clay to about 6 feet below ground surface (bgs). This layer is underlain by brown to gray clay with varying amounts of silt, fine- to medium-grained sand, gravel, and organic matter to the termination depth of the borings (about 15 feet bgs). Bedrock was not encountered during the investigation. Based on review of the Geologic Map of New York, Finger Lakes Sheet (Fisher, Isachsen, Rickard, dated March 1970) , the site is underlain by bedrock of the Syracuse Foundation, consisting of dolostone, shale, gypsum and salt. Based on measurements collected during the Phase II ESA conducted by EA, groundwater at the site flows to the southwest, following the local topography, towards Onondaga Creek. Groundwater was observed at about 6.4 to 9.0 feet bgs (corresponding to el. 382.47 to 383.94). "

Env Problem: "Information submitted with the BCP application regarding the environmental condition at the site are currently under review and will be revised as additional information becomes available."

Health Problem: "Information submitted with the BCP application regarding the conditions at the site are currently under review and will be revised as additional information becomes available."

Dump: Not reported
Structure: Not reported
Lagoon: Not reported
Landfill: Not reported
Pond: Not reported
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: Not reported
Record Upd: Not reported
Updated By: Not reported

EAST ADAMS REDEVELOPMENT - ALMUS OLVER TOWER (Continued) **S131541419**

Own Op:	1
Sub Type:	NNN
Owner Name:	William J Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	4
Sub Type:	NNN
Owner Name:	William J Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Rene Battelle
Owner Company:	Onondaga County Public Libraries-Central Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Allyson Carpenter
Owner Company:	Almus Olver Tower, L.P.
Owner Address:	28 Liberty Street
Owner Addr2:	Not reported
Owner City,St,Zip:	New York, NY 10005
Owner Country:	United States of America
HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	Not reported
Cross Ref Type Code:	Not reported
Cross Ref Type:	Not reported
Record Added Date:	Not reported
Record Updated:	Not reported
Updated By:	Not reported

---

62 **SYRACUSE HOUSING AUTH - PIONEER HOMES** **RCRA-SQG** **1010566801**
ENE **120-122 TYLER COURT** **NY MANIFEST** **NYR000154492**
1/8-1/4 **SYRACUSE, NY 13202**
0.150 mi.
793 ft.

Relative:
Higher

Actual:
400 ft.

RCRA Listings:

Date Form Received by Agency:	20080205
Handler Name:	Syracuse Housing Auth - Pioneer Homes
Handler Address:	Tyler Court
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYR000154492
Contact Name:	WILLIAM W GEHRKE
Contact Address:	BURT ST
Contact City,State,Zip:	SYRACUSE, NY 13202

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566801**

Contact Telephone:	315-470-4315
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Other
Federal Waste Generator Description:	Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	TYLER COURT
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566801**

Manifest Broker: No
Sub-Part P Indicator: No

Hazardous Waste Summary:
Waste Code: D002
Waste Description: Corrosive Waste

Handler - Owner Operator:
Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE HOUSING AUTH
Legal Status: Other
Date Became Current: 19400101
Date Ended Current: Not reported
Owner/Operator Address: 516 BURT ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SYRACUSE HOUSING AUTH
Legal Status: Other
Date Became Current: 19400101
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20080205
Handler Name: SYRACUSE HOUSING AUTH - PIONEER HOMES
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080206
Handler Name: SYRACUSE HOUSING AUTH - PIONEER HOMES
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566801**

Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 92511
NAICS Description: ADMINISTRATION OF HOUSING PROGRAMS

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

NY MANIFEST:
EPA ID: NYR000154492
Country: USA
Name: SYRACUSE HOUSING AUTH - PIONEER HOMES
Address: 120-122 TYLER COURT
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported
Location Address 1: 120-122 TYLER COURT
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: SYRACUSE HOUSING AUTH - PIONEER HOMES
Mailing Contact: WILLIAM GEHILE
Mailing Address 1: 516 BURT ST
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154704315

Manifest Data:
Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NYR000115733
Year: 2018
Trans2 State ID: NYD980761191
Generator Ship Date: 03/12/2008
Trans1 Recv Date: 03/12/2008
Trans2 Recv Date: 03/21/2008
TSD Site Recv Date: 03/25/2008
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000154492
Trans1 EPA ID: Not reported

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566801**

Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	000885788FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	METHANE, DICHLORO- (OR) METHYLENE CHLORIDE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	NYD980761191
Generator Ship Date:	03/12/2008
Trans1 Recv Date:	03/12/2008
Trans2 Recv Date:	03/21/2008
TSD Site Recv Date:	03/25/2008
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000154492
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	000885788FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566801**

Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	CORROSIVE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	165
Units:	Gallons (liquids only)
Number of Containers:	3
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

L63 **WAREHOUSE** **NY UST** **U004339826**
SSW **908 MONTGOMERY ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.156 mi.
823 ft. **Site 1 of 3 in cluster L**

Relative: **Lower**
Actual: **396 ft.**

UST:

Name:	WAREHOUSE
Address:	908 MONTGOMERY ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-991000 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	Not reported
UTM Y:	Not reported
Site Type:	Other Wholesale/Retail Sales

Affiliation Records:

Site Id:	615705
Affiliation Type:	Facility Owner
Company Name:	MORRISVILLE AUXILIARY CORP
Contact Type:	EXECUTIVE DIRECTOR
Contact Name:	JENNIFER BOWDEN
Address1:	PO BOX 901
Address2:	Not reported
City:	MORRISVILLE
State:	NY
Zip Code:	13408
Country Code:	001
Phone:	(315) 684-6048
EMail:	Not reported

WAREHOUSE (Continued) **U004339826**

Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2021-01-14
Site Id:	615705
Affiliation Type:	Mail Contact
Company Name:	MORRISVILLE AUXILIARY CORP
Contact Type:	Not reported
Contact Name:	JENNIFER BOWDEN
Address1:	PO BOX 901
Address2:	Not reported
City:	MORRISVILLE
State:	NY
Zip Code:	13408
Country Code:	001
Phone:	(315) 684-6108
EMail:	BOWDENJJ@MORRISVILLE.EDU
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2021-01-14
Site Id:	615705
Affiliation Type:	Facility Operator
Company Name:	WAREHOUSE
Contact Type:	Not reported
Contact Name:	MORRISVILLE AUXILIARY CORP
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	Not reported
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2021-01-14
Site Id:	615705
Affiliation Type:	Emergency Contact
Company Name:	MORRISVILLE AUXILIARY CORP
Contact Type:	Not reported
Contact Name:	MORRISVILLE AUXILIARY CORP
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 684-6048
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2021-01-14

Tank Info:

WAREHOUSE (Continued) **U004339826**

Tank Number: 001
Tank ID: 289270
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 1000
Install Date: Not reported
Date Tank Closed: 12/02/2020
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

K00 - Spill Prevention - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
J00 - Dispenser - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
L00 - Piping Leak Detection - None

Tank Number: 002
Tank ID: 289271
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 2000
Install Date: Not reported
Date Tank Closed: 12/02/2020
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J00 - Dispenser - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None

WAREHOUSE (Continued) **U004339826**

L00 - Piping Leak Detection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
K00 - Spill Prevention - None

Tank Number:	003
Tank ID:	289272
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	2000
Install Date:	Not reported
Date Tank Closed:	12/02/2020
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Tightness Test Method:	-
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

J00 - Dispenser - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
L00 - Piping Leak Detection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
K00 - Spill Prevention - None

---

64 **CENTRO PARKING INC.** **NY LTANKS** **S100782289**
NNE **SUNY HEALTH SRV. CENTER** **N/A**
1/8-1/4 **SYRACUSE, NY**
0.158 mi.
836 ft.

Relative: **Higher**

Actual: **398 ft.**

LTANKS:

Name:	CENTRO PARKING INC.
Address:	SUNY HEALTH SRV. CENTER
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9311487 / 2001-02-12
Facility ID:	9311487
Site ID:	323404
Spill Date:	1993-12-23
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported

CENTRO PARKING INC. (Continued) **S100782289**

Reported to Dept:	1993-12-23
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1993-12-31
Spill Record Last Update:	2001-02-12
Spiller Name:	Not reported
Spiller Company:	NYS DORMITORY
Spiller Address:	161 DELAWARE AVE
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	260522
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM 12/27/93: SPOKE W/ MIKE,ONFORMED HIM TO PUMP DOWN TANKS AND TO CONTACT HOWARD FOR PROPER CLOSURE OF THE TANK. 09/28/95: This is additional information about material spilled from the translation of the old spill file: TANK FAILURE.
Remarks:	TANKS WAS TESTED JAN 93 OK;NOW APPEARS TO BE TAKING ON WATER. CALLER TO INVEST WITH POSSIBLE CONTRACTOR.

All Materials:

Site ID:	323404
Operable Unit ID:	993371
Operable Unit:	01
Material ID:	390524
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

65
NW
1/8-1/4
0.160 mi.
844 ft.

HARRISON PL & E ADAMS ST **NY LTANKS** **S103824165**
HARRISON PL & E ADAMS ST **N/A**
SYRACUSE, NY

Relative:
Lower

Actual:
394 ft.

LTANKS:

Name:	HARRISON PL & E ADAMS ST
Address:	HARRISON PL & E ADAMS ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9814193 / 1999-04-26
Facility ID:	9814193

HARRISON PL & E ADAMS ST (Continued) **S103824165**

Site ID:	97685
Spill Date:	1999-02-25
Spill Cause:	Tank Failure
Spill Source:	Passenger Vehicle
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1999-02-25
CID:	205
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1999-02-25
Spill Record Last Update:	1999-04-26
Spiller Name:	Not reported
Spiller Company:	KATHLEEN MCLAGGEN
Spiller Address:	CANDLEWWOD GARDENS A41
Spiller County:	001
Spiller Contact:	CALLER
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	86992
Latitude:	43.0427619
Longitude:	-76.1501519
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	GAS TANK SPRUNG A LEAK. CLEANUP COMPLETED.

All Materials:

Site ID:	97685
Operable Unit ID:	1071620
Operable Unit:	01
Material ID:	310897
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

66
SE
1/8-1/4
0.162 mi.
855 ft.

SYRACUSE HOUSING AUTHORITY
BURT & MCBRIDE ST
SYRACUSE, NY 13202

PA MANIFEST **S111771520**
N/A

Relative:
Higher

Actual:
408 ft.

PA MANIFEST:

Name:	SYRACUSE HOUSING AUTHORITY
Address:	BURT & MCBRIDE ST
City,State,Zip:	SYRACUSE, NY 13202
Year:	2009
Manifest Number:	000634453JJK
Manifest Type:	T
Generator EPA ID:	NY0000201889
Generator Date:	12/23/2009
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	NULL
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D009
Container Number:	1
Container Type:	DM
Waste Quantity:	300
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

Year:	2009
Manifest Number:	000634453JJK
Manifest Type:	T
Generator EPA ID:	NY0000201889
Generator Date:	12/23/2009
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	NULL
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	2
Waste Number:	D009
Container Number:	1
Container Type:	DM
Waste Quantity:	200
Unit:	P
Handling Code:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **S111771520**

TSP EPA ID: Not reported
Date TSP Sig: Not reported

M67 **SCHC COMPANIES, INC.** **UST FINDER** **1028590548**
WSW **800 S. SALINA ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.169 mi.
890 ft. **Site 1 of 4 in cluster M**

Relative:
Higher

Actual:
399 ft.

UST FINDER:
Object ID: 318235
Facility ID: NY46751
Name: SCHC COMPANIES, INC.
Address: 800 S. SALINA ST
City,State,Zip: SYRACUSE, NY 13202
Address Match Type: Not reported
Open USTs: 0
Closed USTs: 7
TOS USTs: 0
Population 1500ft: 780
Private Wells 1500ft: 0
Within 100yr Floodplain: No
Land Use: Developed, High Intensity
Within SPA: No
SPA PWS Facility ID: Not reported
SPA Water Type: Not reported
SPA Facility Type: Not reported
SPA HUC12: Not reported
Within WHPA: No
WHPA PWS Facility ID: Not reported
WHPA Water Type: Not reported
WHPA Facility Type: Not reported
WHPA HUC12: Not reported
Facility Status: Closed UST(s)
Date of Last Inspection: Not reported
EPA Region: 2
Tribe: Not reported
Coordinate Source: State
X Coord: -76.150695
Y Coord: 43.0404970000001
Latitude: 43.040497
Longitude: -76.150695

UST FINDER:
Object ID: 1284059
Facility ID: NY46751
Tank ID: NY75271
Tank Status: Closed
Installation Date: 1948/12/01 16:00:01+00
Removal Date: Not reported
Tank Capacity: 550
Substances: Not reported
Tank Wall Type: Not reported

Object ID: 1284060
Facility ID: NY46751
Tank ID: NY75272
Tank Status: Closed

SCHC COMPANIES, INC. (Continued) **1028590548**

Installation Date:	1948/12/01 16:00:01+00
Removal Date:	Not reported
Tank Capacity:	550
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1284061
Facility ID:	NY46751
Tank ID:	NY79713
Tank Status:	Closed
Installation Date:	1948/12/01 16:00:01+00
Removal Date:	Not reported
Tank Capacity:	550
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1284062
Facility ID:	NY46751
Tank ID:	NY79714
Tank Status:	Closed
Installation Date:	1948/12/01 16:00:01+00
Removal Date:	Not reported
Tank Capacity:	550
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1284091
Facility ID:	NY46751
Tank ID:	NY83707
Tank Status:	Closed
Installation Date:	1967/12/01 16:00:01+00
Removal Date:	Not reported
Tank Capacity:	2000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1284092
Facility ID:	NY46751
Tank ID:	NY79715
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	Not reported
Tank Capacity:	1000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1284093
Facility ID:	NY46751
Tank ID:	NY79142
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	Not reported
Tank Capacity:	2000
Substances:	Not reported
Tank Wall Type:	Not reported

M68 **SCHC CO INC CORP OFFICE** **RCRA NonGen / NLR** **1000990680**
WSW **800 S SALINA ST** **FINDS** **NY0001039767**
1/8-1/4 **SYRACUSE, NY 13202** **ECHO**
0.169 mi.
890 ft. **Site 2 of 4 in cluster M**

Relative: **Higher**

Actual: **399 ft.**

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	Schc Co Inc Corp Office
Handler Address:	S Salina St
Handler City,State,Zip:	SYRACUSE, NY 13202-3528
EPA ID:	NY0001039767
Contact Name:	Not reported
Contact Address:	S SALINA ST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	S SALINA ST
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Schc Co Inc
Owner Type:	Private
Operator Name:	Schc Co Inc
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No

SCHC CO INC CORP OFFICE (Continued) **1000990680**

Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	D008
Waste Description:	Lead

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name: SCHC CO INC	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	819 S SALINA ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-476-7921
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: SCHC CO INC	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	819 S SALINA ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-476-7921
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: SCHC CO INC	
Legal Status:	Private
Date Became Current:	Not reported

SCHC CO INC CORP OFFICE (Continued) **1000990680**

Date Ended Current:	Not reported
Owner/Operator Address:	819 S SALINA ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-476-7921
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	19990708
Handler Name: SCHC CO INC CORP OFFICE	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20060101
Handler Name: SCHC CO INC CORP OFFICE	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20070101
Handler Name: SCHC CO INC CORP OFFICE	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	19950217
Handler Name: SCHC CO INC CORP OFFICE	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No

SCHC CO INC CORP OFFICE (Continued) **1000990680**

Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110000806619

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1000990680
Registry ID: 110000806619
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110000806619
Name: SCHC CO INC CORP OFFICE
Address: 800 S SALINA ST
City,State,Zip: SYRACUSE, NY 13202

M69 **SCHC COMPANIES INC** **RCRA NonGen / NLR** **1007204936**
WSW **800 S SALINA ST** **NY MANIFEST** **NYD001039767**
1/8-1/4 **SYRACUSE, NY 13202**
0.169 mi.
890 ft. **Site 3 of 4 in cluster M**

Relative:
Higher

Actual:
399 ft.

RCRA Listings:
Date Form Received by Agency: 20070101
Handler Name: Schc Companies Inc
Handler Address: 800 S Salina St
Handler City,State,Zip: SYRACUSE, NY 13202-0000
EPA ID: NYD001039767
Contact Name: JAMES COOK
Contact Address: 819 S SALINA ST
Contact City,State,Zip: SYRACUSE, NY 13202-0000
Contact Telephone: 315-476-7921 x264
Contact Fax: Not reported
Contact Email: Not reported
Contact Title: Not reported

SCHC COMPANIES INC (Continued) **1007204936**

EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	819 S SALINA ST
Mailing City,State,Zip:	SYRACUSE, NY 13202-0000
Owner Name:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

SCHC COMPANIES INC (Continued) **1007204936**

Historic Generators:

Receive Date:	20060101
Handler Name: SCHC COMPANIES INC	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20070101
Handler Name: SCHC COMPANIES INC	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	19960131
Handler Name: SCHC COMPANIES INC	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Code:	324199
NAICS Description:	ALL OTHER PETROLEUM AND COAL PRODUCTS MANUFACTURING

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

NY MANIFEST:

EPA ID:	NYD001039767
Country:	USA
Name:	SYRACUSE COMMUNITY HEALTH CENTER INC

SCHC COMPANIES INC (Continued) **1007204936**

Address:	800 S SALINA ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202-0000
Zip 4:	Not reported
Location Address 1:	819 SOUTH SALINA STREET
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	SYRACUSE COMMUNITY HEALTH CENTER INC
Mailing Contact:	JAMES E COX
Mailing Address 1:	819 SOUTH SALINA STREET
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154767921

Manifest Data:

Document ID:	NYB6836364
Manifest Status:	Not reported
Trans1 State ID:	PP6163NY
Year:	1995
Trans2 State ID:	PP6163NY
Generator Ship Date:	04/10/1995
Trans1 Recv Date:	04/10/1995
Trans2 Recv Date:	04/11/1995
TSD Site Recv Date:	04/11/1995
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001039767
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	NYD980761191
TSDF ID 1:	NYD095577342
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported

SCHC COMPANIES INC (Continued) **1007204936**

Quantity:	01530
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Recycle
Specific Gravity:	01.00

M70 **SCHC COMPANIES, INC.** **NY UST** **U002096586**
WSW **800 S. SALINA ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.169 mi.
890 ft. **Site 4 of 4 in cluster M**

Relative:
Higher

Actual:
399 ft.

UST:

Name:	SCHC COMPANIES, INC.
Address:	800 S. SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-600313 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	406269.92524
UTM Y:	4765954.37006
Site Type:	Other

Affiliation Records:

Site Id:	46751
Affiliation Type:	Facility Owner
Company Name:	SCHC COMPANIES, INC.
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	819 S. SALINA ST.
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 476-7921
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	46751
Affiliation Type:	Mail Contact
Company Name:	SCHC COMPANIES, INC.
Contact Type:	Not reported
Contact Name:	JAMES E. COOK
Address1:	819 S. SALINA ST.
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 476-7921
EMail:	Not reported

SCHC COMPANIES, INC. (Continued) **U002096586**

Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 46751
Affiliation Type: Facility Operator
Company Name: SCHC COMPANIES, INC.
Contact Type: Not reported
Contact Name: N\\A
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: Not reported
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 46751
Affiliation Type: Emergency Contact
Company Name: SCHC COMPANIES, INC.
Contact Type: Not reported
Contact Name: JAMES E. COOK
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (315) 476-7921
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 001
Tank ID: 136854
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 2000
Install Date: 12/01/1967
Date Tank Closed: 04/01/1995
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported

SCHC COMPANIES, INC. (Continued) **U002096586**

Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

B00 - Tank External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Number: 002
Tank ID: 136855
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1948
Date Tank Closed: 04/01/1995
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Number: 003
Tank ID: 136856
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1948
Date Tank Closed: 04/01/1995
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

SCHC COMPANIES, INC. (Continued) **U002096586**

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None

Tank Number: 004
Tank ID: 136857
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1948
Date Tank Closed: 04/01/1995
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Number: 005
Tank ID: 136858
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1948
Date Tank Closed: 04/01/1995
Registered: True
Tank Location: Underground

SCHC COMPANIES, INC. (Continued) **U002096586**

Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
I00 - Overfill - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None

Tank Number: 006
Tank ID: 137144
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 2000
Install Date: Not reported
Date Tank Closed: 04/01/1995
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
J00 - Dispenser - None
A00 - Tank Internal Protection - None

Tank Number: 007
Tank ID: 137145
Tank Status: Closed - Removed
Material Name: Closed - Removed

SCHC COMPANIES, INC. (Continued) **U002096586**

Capacity Gallons:	1000
Install Date:	Not reported
Date Tank Closed:	04/01/1995
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J00 - Dispenser - None
A00 - Tank Internal Protection - None

N71 **BENJAMIN RUSH CENTER** **UST FINDER** **1028589492**
West **672 S SALINA ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.181 mi.
954 ft. **Site 1 of 6 in cluster N**

Relative: UST FINDER:
Lower

Actual:
396 ft.

Object ID:	318091
Facility ID:	NY45699
Name:	BENJAMIN RUSH CENTER
Address:	672 S SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	4
TOS USTs:	0
Population 1500ft:	1933
Private Wells 1500ft:	0
Within 100yr Floodplain:	Yes
Land Use:	Developed, Low Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Closed UST(s)

BENJAMIN RUSH CENTER (Continued) **1028589492**

Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.159162
Y Coord:	43.032252
Latitude:	43.032252
Longitude:	-76.159162

UST FINDER:

Object ID:	1280774
Facility ID:	NY45699
Tank ID:	NY73035
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	Not reported
Tank Capacity:	1000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1280775
Facility ID:	NY45699
Tank ID:	NY73036
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	Not reported
Tank Capacity:	1000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1280776
Facility ID:	NY45699
Tank ID:	NY75992
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	Not reported
Tank Capacity:	1000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1280777
Facility ID:	NY45699
Tank ID:	NY75993
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	Not reported
Tank Capacity:	1000
Substances:	Not reported
Tank Wall Type:	Not reported

N72 **BENJAMIN RUSH CENTER** **NY UST** **U003313547**
West **672 S SALINA ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.181 mi.
954 ft. **Site 2 of 6 in cluster N**

Relative:
Lower

Actual:
396 ft.

UST:

Name:	BENJAMIN RUSH CENTER
Address:	672 S SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-418064 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	405567.62390
UTM Y:	4765048.26888
Site Type:	Unknown

Affiliation Records:

Site Id:	45699
Affiliation Type:	Facility Owner
Company Name:	F J MCCARTHY JR D/B/A BENJ RUS
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	672 S SALINA ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 476-2161
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45699
Affiliation Type:	Mail Contact
Company Name:	F J MCCARTHY JR D/B/A BENJ RUS
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	672 S SALINA ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 476-2161
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45699
Affiliation Type:	Facility Operator
Company Name:	BENJAMIN RUSH CENTER
Contact Type:	Not reported
Contact Name:	F J MCCARTHY JR D/B/A BENJ RUS
Address1:	Not reported

BENJAMIN RUSH CENTER (Continued) **U003313547**

Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 476-2161
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45699
Affiliation Type:	Emergency Contact
Company Name:	F J MCCARTHY JR D/B/A BENJ RUS
Contact Type:	Not reported
Contact Name:	JEAN KLYM
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 476-2185
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Tank Info:

Tank Number:	001
Tank ID:	134394
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	1000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
F00 - Pipe External Protection - None
B00 - Tank External Protection - None

BENJAMIN RUSH CENTER (Continued) **U003313547**

C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None

Tank Number: 002
Tank ID: 134395
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 1000
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: 003
Tank ID: 134396
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 1000
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

BENJAMIN RUSH CENTER (Continued) **U003313547**

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number:	004
Tank ID:	134397
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	1000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

N73 **JUPP CORP** **UST FINDER** **1028588234**
West **680 SOUTH SALINA ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.181 mi.
957 ft. **Site 3 of 6 in cluster N**

Relative: **Lower**
Actual: **396 ft.**

UST FINDER:

Object ID:	318258
Facility ID:	NY44475
Name:	JUPP CORP
Address:	680 SOUTH SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	8
TOS USTs:	0

JUPP CORP (Continued) **1028588234**

Population 1500ft:	722
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Closed UST(s)
Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.150995
Y Coord:	43.0411710000001
Latitude:	43.041171
Longitude:	-76.150995

UST FINDER:

Object ID:	1275914
Facility ID:	NY44475
Tank ID:	NY68590
Tank Status:	Closed
Installation Date:	1987/10/02 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	4000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1275915
Facility ID:	NY44475
Tank ID:	NY69656
Tank Status:	Closed
Installation Date:	1987/10/02 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	6000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1275916
Facility ID:	NY44475
Tank ID:	NY117690
Tank Status:	Closed
Installation Date:	1987/10/02 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	8000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1275917
Facility ID:	NY44475
Tank ID:	NY74159

JUPP CORP (Continued) **1028588234**

Tank Status: Closed
Installation Date: Not reported
Removal Date: Not reported
Tank Capacity: 2000
Substances: Not reported
Tank Wall Type: Not reported

Object ID: 1275918
Facility ID: NY44475
Tank ID: NY74160
Tank Status: Closed
Installation Date: Not reported
Removal Date: Not reported
Tank Capacity: 2000
Substances: Not reported
Tank Wall Type: Not reported

Object ID: 1275919
Facility ID: NY44475
Tank ID: NY74161
Tank Status: Closed
Installation Date: Not reported
Removal Date: Not reported
Tank Capacity: 2000
Substances: Not reported
Tank Wall Type: Not reported

Object ID: 1275920
Facility ID: NY44475
Tank ID: NY77081
Tank Status: Closed
Installation Date: Not reported
Removal Date: Not reported
Tank Capacity: 3000
Substances: Not reported
Tank Wall Type: Not reported

Object ID: 1275921
Facility ID: NY44475
Tank ID: NY77082
Tank Status: Closed
Installation Date: Not reported
Removal Date: Not reported
Tank Capacity: 3000
Substances: Not reported
Tank Wall Type: Not reported

N74 **680 SOUTH SALINA ST GAS STATION** **NY LTANKS** **S106011637**
West **680 SOUTH SALINA ST** **NY Spills** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.181 mi.
957 ft. **Site 4 of 6 in cluster N**

Relative: **Lower**

Actual: **396 ft.**

LTANKS:

Name:	JUPP CORP
Address:	680 SOUTH SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1600634 / 2019-12-10
Facility ID:	1600634
Site ID:	525912
Spill Date:	2016-04-18
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	D4
Cleanup Ceased:	2017-06-20
SWIS:	3415
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2016-04-18
CID:	Not reported
Water Affected:	NONE
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2016-04-18
Spill Record Last Update:	2019-12-10
Spiller Name:	BALJIT KAUR
Spiller Company:	JUPP CORP
Spiller Address:	680 SOUTH SALINA ST
Spiller County:	999
Spiller Contact:	BALJIP KAUR
Spiller Phone:	(315) 422-1225
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	43841
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	4/19/2016 - Per John Gramz / Primetime Services, 6,000 gallon UST Tank 857A failed tank tightness test when product discovered in interstitial space. This was the sole remaining functional UST at this location. Previously 8,000 gallon UST Tank 859 (master) failed, effectively also removing satellite 4,000 gallon UST Tank 857B from service due to lack of submersible. PBS # is 7-102830. Contacted Facility owner and operator to determine permanent closure plans for these tanks. KCKemp
Remarks:	inner wall failed test, tank is OOS. unfurther.

All Materials:

Site ID:	525912
Operable Unit ID:	1274858
Operable Unit:	01
Material ID:	2279520
Material Code:	0009
Material Name:	gasoline

680 SOUTH SALINA ST GAS STATION (Continued) **S106011637**

Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	JUPP CORP
Address:	680 SOUTH SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1600634 / 2019-12-10
Facility ID:	1600634
Site ID:	525912
Spill Date:	2016-04-18
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	D4
Cleanup Ceased:	2017-06-20
SWIS:	3415
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2016-04-18
CID:	Not reported
Water Affected:	NONE
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2016-04-18
Spill Record Last Update:	2019-12-10
Spiller Name:	HARMANDEEP SINGH SEKHON
Spiller Company:	ABMH PROPERTIES LLC
Spiller Address:	81-18-242 ST
Spiller County:	001
Spiller Contact:	BALJIP KAUR
Spiller Phone:	(315) 422-1225
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	43841
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	4/19/2016 - Per John Gramz / Primetime Services, 6,000 gallon UST Tank 857A failed tank tightness test when product discovered in interstitial space. This was the sole remaining functional UST at this location. Previously 8,000 gallon UST Tank 859 (master) failed, effectively also removing satellite 4,000 gallon UST Tank 857B from service due to lack of submersible. PBS # is 7-102830. Contacted Facility owner and operator to determine permanent closure plans for these tanks. KCKemp
Remarks:	inner wall failed test, tank is OOS. unfurther.

All Materials:

Site ID:	525912
Operable Unit ID:	1274858

680 SOUTH SALINA ST GAS STATION (Continued) **S106011637**

Operable Unit:	01
Material ID:	2279520
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	DESIMONES SERVICE STA.
Address:	680 S. SALINA ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8705408 / 1987-10-28
Facility ID:	8705408
Site ID:	265820
Spill Date:	1987-09-28
Spill Cause:	Tank Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	Not reported
Cleanup Ceased:	1987-10-28
SWIS:	3415
Investigator:	AJMARSCH
Referred To:	Not reported
Reported to Dept:	1987-09-28
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1987-10-05
Spill Record Last Update:	1997-11-19
Spiller Name:	Not reported
Spiller Company:	DESIMONES GAS STATION
Spiller Address:	680 S. SALINA ST.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	216600
Latitude:	43.0411039
Longitude:	-76.1509018
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was JM
Remarks:	/ / : REMOVED CONTAMINATED SOIL. HAULED AWAY BY ENV. OIL. EXCAVATION REVEALED CONTAMINATED SOIL.

All Materials:

Site ID:	265820
Operable Unit ID:	909231
Operable Unit:	01
Material ID:	468011

680 SOUTH SALINA ST GAS STATION (Continued) **S106011637**

Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

SPILLS:

Name:	680 SOUTH SALINA ST GAS STATION
Address:	680 SOUTH SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1703133 / 2017-08-17
Facility ID:	1703133
Facility Type:	ER
DER Facility ID:	43841
Site ID:	554293
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	B3
SWIS:	3415
Spill Date:	2017-06-27
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2017-06-27
CID:	Not reported
Water Affected:	NONE
Spill Source:	Non Major Facility > 1,100 gal
Spill Notifier:	Other
Cleanup Ceased:	2017-08-17
Cleanup Meets Std:	False
Last Inspection:	2017-06-27
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2017-06-29
Spill Record Last Update:	2020-06-17
Spiller Name:	BALJIT KAUR
Spiller Company:	680 S. SALINA ST LLC
Spiller Address:	3987 WEST LANGERWOOD LN
Spiller Company:	999
Contact Name:	BALJIT KAUR
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	6/27/2017 - PRODUCT OBSERVED BENEATH TANKS WHILE REMOVING TANKS. KCKEMP 8/17/2017 - Closure Report received and filed. Awaiting soil disposal by LSFS. KCKemp
Remarks:	Not reported

All Materials:

Site ID:	554293
Operable Unit ID:	1302370
Operable Unit:	01
Material ID:	2308755

680 SOUTH SALINA ST GAS STATION (Continued) **S106011637**

Material Code:	2712
Material Name:	gasoline/ethanol
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Soil, Groundwater
Oxygenate:	Not reported

Name:	DESIMONES GAS STATION
Address:	680 S SALINA ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0211565 / 2003-07-21
Facility ID:	0211565
Facility Type:	ER
DER Facility ID:	235787
Site ID:	291210
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	3415
Spill Date:	2003-02-21
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2003-02-21
CID:	365
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2003-02-21
Spill Record Last Update:	2003-10-06
Spiller Name:	ERNIE DESIMONE
Spiller Company:	DESIMONES GAS STATION
Spiller Address:	680 S SALINA ST
Spiller Company:	001
Contact Name:	ERNIE DESIMONE
Latitude:	43.0411039
Longitude:	-76.1509018
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	possilby former leaking tanks or surface spills - got lab results back today indicating gasoline contamination

All Materials:

Site ID:	291210
Operable Unit ID:	862674
Operable Unit:	01
Material ID:	2106927
Material Code:	1213A
Material Name:	MTBE (methyl-tert-butyl ether)
Case No.:	01634044

680 SOUTH SALINA ST GAS STATION (Continued) **S106011637**

Material FA:	Hazardous Material
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	True
Site ID:	291210
Operable Unit ID:	862674
Operable Unit:	01
Material ID:	573999
Material Code:	2645A
Material Name:	BTEX
Case No.:	Not reported
Material FA:	Oxygenates
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	True
Site ID:	291210
Operable Unit ID:	862674
Operable Unit:	01
Material ID:	511351
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	True

N75 **DESIMONES SERVICE STA.** **UST FINDER RELEASE** **1029065966**
West **680 S. SALINA ST** **N/A**
1/8-1/4 **SYRACUSE, NY 0**
0.181 mi.
957 ft. **Site 5 of 6 in cluster N**

Relative: **Lower**
Actual: **396 ft.**

UST FINDER RELEASE:

Object ID:	249455
Facility ID:	NY216600
Lust ID:	NY8705408
Name:	DESIMONES SERVICE STA.
Address:	680 S. SALINA ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1987/09/28 16:00:00+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	722
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported

DESIMONES SERVICE STA. (Continued) **1029065966**

SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1509
Y Coord:	43.0411
Latitude:	43.0411
Longitude:	-76.1508999999999

N76 **CAN AM ALLIANCE CORP** **NY UST** **U000413241**
West **680 SOUTH SALINA ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.181 mi.
957 ft. **Site 6 of 6 in cluster N**

Relative: **Lower**

Actual: **396 ft.**

UST:

Name:	CAN AM ALLIANCE CORP
Address:	680 SOUTH SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-102830 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	04/10/2027
UTM X:	406230.74925
UTM Y:	4765992.67221
Site Type:	Retail Gasoline Sales

Affiliation Records:

Site Id:	44475
Affiliation Type:	Mail Contact
Company Name:	680 SOUTH SALINA STREET LLC
Contact Type:	Not reported
Contact Name:	BALJIT KAUR
Address1:	680 SOUTH SALINA ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 480-1257
EMail:	BALJITKAURUSA1@YAHOO.COM
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2017-04-10

CAN AM ALLIANCE CORP (Continued) **U000413241**

Site Id:	44475
Affiliation Type:	Facility Operator
Company Name:	JUPP CORP
Contact Type:	Not reported
Contact Name:	BALJIT KAUR
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 480-1257
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2017-06-21

Site Id:	44475
Affiliation Type:	Emergency Contact
Company Name:	ABMH PROPERTIES LLC
Contact Type:	Not reported
Contact Name:	BALJIT KAUR
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(315) 436-7410
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2014-09-22

Site Id:	44475
Affiliation Type:	Facility Owner
Company Name:	CAN AM ALLIANCE CORP
Contact Type:	PRESIDENT
Contact Name:	BALJIT KAUR
Address1:	680 SOUTH SALINA ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 480-1257
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2019-09-13

Tank Info:

Tank Number:	001
Tank ID:	127512
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91

CAN AM ALLIANCE CORP (Continued) **U000413241**

Capacity Gallons:	2000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H04 - Tank Leak Detection - Groundwater Well
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A01 - Tank Internal Protection - Epoxy Liner
I00 - Overfill - None

Tank Number:	002
Tank ID:	127513
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	3000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None
I00 - Overfill - None
A01 - Tank Internal Protection - Epoxy Liner
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H04 - Tank Leak Detection - Groundwater Well
B00 - Tank External Protection - None

CAN AM ALLIANCE CORP (Continued) **U000413241**

Tank Number: 003
Tank ID: 127514
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 2000
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H04 - Tank Leak Detection - Groundwater Well
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A01 - Tank Internal Protection - Epoxy Liner
I00 - Overfill - None

Tank Number: 004
Tank ID: 127515
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 3000
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H04 - Tank Leak Detection - Groundwater Well

CAN AM ALLIANCE CORP (Continued) **U000413241**

A01 - Tank Internal Protection - Epoxy Liner
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Tank Number:	005
Tank ID:	127516
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	2000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

H04 - Tank Leak Detection - Groundwater Well
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None
I00 - Overfill - None
A01 - Tank Internal Protection - Epoxy Liner

Tank Number:	007A
Tank ID:	281571
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	11000
Install Date:	09/01/2019
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Tightness Test Method:	-
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

F05 - Pipe External Protection - Jacketed
E04 - Piping Secondary Containment - Double walled UG

CAN AM ALLIANCE CORP (Continued) **U000413241**

J01 - Dispenser - Pressurized Dispenser
C02 - Pipe Location - Underground/On-ground
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
D11 - Pipe Type - Flexible Piping
G04 - Tank Secondary Containment - Double-Walled (Underground)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off
B04 - Tank External Protection - Fiberglass
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin

Tank Number: 007B
Tank ID: 281572
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 09/01/2019
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

D11 - Pipe Type - Flexible Piping
G04 - Tank Secondary Containment - Double-Walled (Underground)
F05 - Pipe External Protection - Jacketed
C02 - Pipe Location - Underground/On-ground
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
B04 - Tank External Protection - Fiberglass
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin

Tank Number: 857A
Tank ID: 127518
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 6000
Install Date: 10/02/1987
Date Tank Closed: 06/20/2017
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel

CAN AM ALLIANCE CORP (Continued) **U000413241**

Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

C03 - Pipe Location - Aboveground/Underground Combination
K01 - Spill Prevention - Catch Basin
E00 - Piping Secondary Containment - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
I01 - Overfill - Float Vent Valve
B01 - Tank External Protection - Painted/Asphalt Coating
A00 - Tank Internal Protection - None
H02 - Tank Leak Detection - Interstitial - Manual Monitoring
J01 - Dispenser - Pressurized Dispenser
B02 - Tank External Protection - Original Sacrificial Anode
D02 - Pipe Type - Galvanized Steel
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
F02 - Pipe External Protection - Original Sacrificial Anode

Tank Number: 857B-S1
Tank ID: 231003
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 10/02/1987
Date Tank Closed: 06/20/2017
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

H02 - Tank Leak Detection - Interstitial - Manual Monitoring
J01 - Dispenser - Pressurized Dispenser
G04 - Tank Secondary Containment - Double-Walled (Underground)
B02 - Tank External Protection - Original Sacrificial Anode
D02 - Pipe Type - Galvanized Steel
C03 - Pipe Location - Aboveground/Underground Combination
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
I01 - Overfill - Float Vent Valve
K01 - Spill Prevention - Catch Basin
F02 - Pipe External Protection - Original Sacrificial Anode
A00 - Tank Internal Protection - None

CAN AM ALLIANCE CORP (Continued) **U000413241**

B01 - Tank External Protection - Painted/Asphalt Coating
E00 - Piping Secondary Containment - None

Tank Number:	859-M1
Tank ID:	127517
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	8000
Install Date:	10/02/1987
Date Tank Closed:	06/20/2017
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	2712
Common Name of Substance:	Gasoline/Ethanol
Tightness Test Method:	-
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

C03 - Pipe Location - Aboveground/Underground Combination
G04 - Tank Secondary Containment - Double-Walled (Underground)
B02 - Tank External Protection - Original Sacrificial Anode
D02 - Pipe Type - Galvanized Steel
H02 - Tank Leak Detection - Interstitial - Manual Monitoring
J01 - Dispenser - Pressurized Dispenser
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I01 - Overfill - Float Vent Valve
E00 - Piping Secondary Containment - None
K01 - Spill Prevention - Catch Basin
F02 - Pipe External Protection - Original Sacrificial Anode
L07 - Piping Leak Detection - Pressurized Piping Leak Detector

---

L77 **FAMILY DOLLAR #5071** **NY MANIFEST** **S118708542**
SW **945 S SALINA ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.181 mi.
957 ft. **Site 2 of 3 in cluster L**

Relative: **Lower**
Actual: **396 ft.**

NY MANIFEST:

EPA ID:	NYR000211730
Country:	USA
Name:	FAMILY DOLLAR #5071
Address:	945 S SALINA ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	945 S SALINA ST
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported

FAMILY DOLLAR #5071 (Continued) **S118708542**

Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: FAMILY DOLLAR #5071
Mailing Contact: FAMILY DOLLAR #5071
Mailing Address 1: 945 S SALINA ST
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: Not reported

Manifest Data:
Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: PAD982661381
Year: 2018
Trans2 State ID: NJR000063677
Generator Ship Date: 05/17/2016
Trans1 Recv Date: 05/17/2016
Trans2 Recv Date: 05/24/2016
TSD Site Recv Date: 05/25/2016
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000211730
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: RID040098352
TSDF ID 2: Not reported
Manifest Tracking Number: 009248480FLE
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H141
Waste Code a: IGNITABLE WASTE
Waste Code b: Not reported
Waste Code c: Not reported
Waste Code e: Not reported
Waste Code f: Not reported
Waste Code g: Not reported
Waste Code 1: Not reported
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 13
Units: Pounds
Number of Containers: 1

FAMILY DOLLAR #5071 (Continued) **S118708542**

Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD982661381
Year:	2018
Trans2 State ID:	NJR000063677
Generator Ship Date:	05/17/2016
Trans1 Recv Date:	05/17/2016
Trans2 Recv Date:	05/24/2016
TSD Site Recv Date:	05/25/2016
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000211730
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	RID040098352
TSDF ID 2:	Not reported
Manifest Tracking Number:	009248480FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	IGNITABLE WASTE
Waste Code b:	METHYL ETHYL KETONE
Waste Code c:	2-PROPANONE (I) (OR) ACETONE (I)
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	3
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD982661381
Year:	2018
Trans2 State ID:	NJR000063677
Generator Ship Date:	05/17/2016

FAMILY DOLLAR #5071 (Continued) **S118708542**

Trans1 Recv Date:	05/17/2016
Trans2 Recv Date:	05/24/2016
TSD Site Recv Date:	05/25/2016
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000211730
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	RID040098352
TSDF ID 2:	Not reported
Manifest Tracking Number:	009248480FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Not reported
Waste Code b:	CORROSIVE WASTE
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	10
Units:	Pounds
Number of Containers:	1
Container Type:	Burlap, cloth, paper or plastic bags
Handling Method:	Treat
Specific Gravity:	1

L78 **FAMILY DOLLAR #5071** **RCRA-VSQG** **1016974714**
SW **945 S SALINA ST** **ECHO** **NYR000211730**
1/8-1/4 **SYRACUSE, NY 13202**
0.181 mi.
957 ft. **Site 3 of 3 in cluster L**

Relative: RCRA Listings:
Lower

Date Form Received by Agency:	20140806
Handler Name:	Family Dollar #5071
Handler Address:	S Salina St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYR000211730
Contact Name:	KEVIN STRAIGHT
Contact Address:	PO BOX 1017
Contact City,State,Zip:	CHARLOTTE, NC 28201
Contact Telephone:	704-708-1909

Actual:
396 ft.

FAMILY DOLLAR #5071 (Continued) **1016974714**

Contact Fax:	Not reported
Contact Email:	KSTRAIGHT@FAMILYDOLLAR.COM
Contact Title:	PROGRAM MANAGER ENVIRONMENTAL COMPLIANCE
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	PO BOX 1017
Mailing City,State,Zip:	CHARLOTTE, NC 28201
Owner Name:	Family Dollar Stores
Owner Type:	Private
Operator Name:	Family Dollar Stores
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20151218
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No

FAMILY DOLLAR #5071 (Continued) **1016974714**

Sub-Part P Indicator: No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	D004
Waste Description:	Arsenic
Waste Code:	D005
Waste Description:	Barium
Waste Code:	D007
Waste Description:	Chromium
Waste Code:	D008
Waste Description:	Lead
Waste Code:	D009
Waste Description:	Mercury
Waste Code:	D010
Waste Description:	Selenium
Waste Code:	D011
Waste Description:	Silver
Waste Code:	D016
Waste Description:	2,4-D (2,4-Dichlorophenoxyacetic Acid)
Waste Code:	D024
Waste Description:	M-Cresol
Waste Code:	D035
Waste Description:	Methyl Ethyl Ketone
Waste Code:	U002
Waste Description:	2-Propanone (I) (Or) Acetone (I)

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: FAMILY DOLLAR STORES	
Legal Status:	Private
Date Became Current:	20020516
Date Ended Current:	Not reported
Owner/Operator Address:	10301 MONROE RD
Owner/Operator City,State,Zip:	MATTHEWS, NC 28105
Owner/Operator Telephone:	866-377-6420
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name: FAMILY DOLLAR STORES	
Legal Status:	Private

FAMILY DOLLAR #5071 (Continued) **1016974714**

Date Became Current:	20020516
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20140806
Handler Name: FAMILY DOLLAR #5071	
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Code:	45299
NAICS Description:	ALL OTHER GENERAL MERCHANDISE STORES

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

ECHO:

Envid:	1016974714
Registry ID:	110060282493
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110060282493
Name:	FAMILY DOLLAR #5071
Address:	945 S SALINA ST
City,State,Zip:	SYRACUSE, NY 13202

---

79 **NIAGARA MOHAWK POWER CORP** **NY LTANKS** **S108294880**
SSE **235 OAKWOOD AVE. EXT.** **NY Spills** **N/A**
1/8-1/4 **TROY, NY 13202** **NY MANIFEST**
0.183 mi.
964 ft.

Relative:
Higher

Actual:
398 ft.

LTANKS:

Name:	NIMO OAKWOOD AVE RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	9409889 / 1995-04-18
Facility ID:	9409889
Site ID:	327666

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Spill Date:	1994-10-24
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	B3
Cleanup Ceased:	1995-02-28
SWIS:	4217
Investigator:	WXOBRIEN
Referred To:	Not reported
Reported to Dept:	1994-10-24
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1994-11-03
Spill Record Last Update:	2012-07-18
Spiller Name:	Not reported
Spiller Company:	NIAGARA MOHAWK NIMO
Spiller Address:	Not reported
Spiller County:	999
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	4
DER Facility ID:	263775
Latitude:	42.7997285
Longitude:	-73.6401897
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was O'BRIEN Tank pit contaminated from leakage. not leaving area. Will have to remediate when tanks are replaced. PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374. 4/28/06 GW results from 1995 show low levels ~ 1.5 ppm
Remarks:	SEE RPT, DOB TELECON W/M&E, 4K UGT FAILED PETROTITE @ GROSS RATE. TANK FIXED & PASSED RETEST.

All TTF:

Facility ID:	9409889
Spill Number:	9409889
Spill Tank Test:	1543277
Site ID:	327666
Tank Number:	Not reported
Tank Size:	0
Material:	0008
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

All Materials:

Site ID:	327666
Operable Unit ID:	1003862
Operable Unit:	01
Material ID:	375762
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

SPILLS:

Name:	NIMO OAKWOOD AVE RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	9511298 / 1996-07-12
Facility ID:	9511298
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327667
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	4217
Spill Date:	1995-12-06
Investigator:	WEBLAIN
Referred To:	Not reported
Reported to Dept:	1995-12-07
CID:	216
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1995-12-07
Spill Record Last Update:	2012-07-18
Spiller Name:	MARTIN CONDON
Spiller Company:	NIAGARA MOHAWK NIMO
Spiller Address:	235 OAKWOOD AVENUE
Spiller Company:	001
Contact Name:	MARTIN CONDON
Latitude:	42.7997285
Longitude:	-73.6401897
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BLAIN NO RESPONSE. HOTLINE HAD SPILLER AS NOMO . PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104,

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

0405144, 0405710, 0509374.
Remarks: EMPLOYEES WERE PUMPING OIL TO AN OUTSIDE DRUM ALARM ON OUTSIDE DRUM NEVER ACTIVATED CAUSEING A OVERFLOW

All Materials:
Site ID: 327667
Operable Unit ID: 1025523
Operable Unit: 01
Material ID: 358646
Material Code: 0015
Material Name: motor oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 15.00
Units: G
Recovered: 15.00
Resource Affected: Soil
Oxygenate: Not reported

Name: NIMO GARAGE TRANSFORMER OAKWOOD RT 40
Address: 235 OAKWOOD AVE RT 40
City,State,Zip: TROY, NY
Spill Number/Closed Date: 9800231 / 1998-04-06
Facility ID: 9800231
Facility Type: ER
DER Facility ID: 263775
Site ID: 327668
DEC Region: 4
Spill Cause: Human Error
Spill Class: C4
SWIS: 4217
Spill Date: 1998-04-06
Investigator: WEBLAIN
Referred To: Not reported
Reported to Dept: 1998-04-06
CID: 233
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1998-04-06
Spill Record Last Update: 2012-07-18
Spiller Name: BILL LYSOGORSKI
Spiller Company: NIAGARA MOHAWK NIMO
Spiller Address: 5215 WESTER TRNPK [SP]
Spiller Company: 001
Contact Name: Not reported
Latitude: 42.7997285
Longitude: -73.6401897
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was BLAIN PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144,

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

0405710, 0509374.
Remarks: TRANSFORMER FELL FROM PALLET WHILE BE MOVED SPILL TO PAVEMENT AND GRAVEL AREA CLEAN UP BY CALLERS CREW

All Materials:
Site ID: 327668
Operable Unit ID: 1060738
Operable Unit: 01
Material ID: 325774
Material Code: 0020A
Material Name: transformer oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 2.00
Units: G
Recovered: 2.00
Resource Affected: Soil
Oxygenate: Not reported

Name: NIMO SERV CTR OAKWOOD AVE RT 40
Address: 235 OAKWOOD AVE RT 40
City,State,Zip: TROY, NY
Spill Number/Closed Date: 0212237 / 2003-11-13
Facility ID: 0212237
Facility Type: ER
DER Facility ID: 263775
Site ID: 327660
DEC Region: 4
Spill Cause: Human Error
Spill Class: C3
SWIS: 4217
Spill Date: 2003-03-13
Investigator: WEBLAIN
Referred To: Not reported
Reported to Dept: 2003-03-13
CID: 365
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2003-03-13
Spill Record Last Update: 2012-07-18
Spiller Name: CALLER
Spiller Company: NIAGARA MOHAWK NIMO
Spiller Address: OAKWOOD AV
Spiller Company: 001
Contact Name: TOM SULLIVAN
Latitude: 42.7997285
Longitude: -73.6401897
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was BLAIN PBS 4-429503; see 8708047,
9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144,

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

0405710, 0509374. 11/13/2003 NIMO reports factory labeled non-PCB. Cleanup complete.
Remarks: forklift driver hit a pad mounted transformer w/ the forklift causing spill to concrete - clean up in progress

All Materials:

Site ID:	327660
Operable Unit ID:	865689
Operable Unit:	01
Material ID:	511973
Material Code:	0020A
Material Name:	transformer oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	30.00
Units:	G
Recovered:	25.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NIMO TRANSFORMER OAKWOOD RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	0405104 / 2004-08-30
Facility ID:	0405104
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327661
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	4217
Spill Date:	2004-08-10
Investigator:	WEBLAIN
Referred To:	Not reported
Reported to Dept:	2004-08-10
CID:	444
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-08-10
Spill Record Last Update:	2012-07-18
Spiller Name:	BARBARA SCHEURER
Spiller Company:	TRANSFORMER PAD [NIMO]
Spiller Address:	235 OAKWOOD AVE
Spiller Company:	001
Contact Name:	BARBARA SCHEURER
Latitude:	42.7669450
Longitude:	-73.6610140
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BLAIN 8/30/04 Blain contacted

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Barb Schuerer, NIMO. Non-PCB oil. cleaned up. PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374.

Remarks: TRANSFORMER DETERIORATED AND STARTED TO LEAK: CREW ON SCENE AND HAZMAT ON WAY: SPEEDI DRI AND PADS PLACED: 2 QUARTS SPILLED OUT:

All Materials:

Site ID:	327661
Operable Unit ID:	887978
Operable Unit:	01
Material ID:	489122
Material Code:	0020A
Material Name:	transformer oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Site ID:	327661
Operable Unit ID:	887978
Operable Unit:	01
Material ID:	489123
Material Code:	0020A
Material Name:	transformer oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NIMO TRANSFORMER OAKWOOD RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	0405144 / 2004-08-30
Facility ID:	0405144
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327662
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	4217
Spill Date:	2004-08-10
Investigator:	WEBLAIN
Referred To:	Not reported
Reported to Dept:	2004-08-10
CID:	407
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-08-10
Spill Record Last Update:	2012-07-18
Spiller Name:	TOM SULLIVAN
Spiller Company:	NIMO
Spiller Address:	235 OAKWOOD AVE
Spiller Company:	001
Contact Name:	TOM SULLIVAN
Latitude:	42.7669450
Longitude:	-73.6610140
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BLAIN 8/30/2004 Blain contacted NIMO. Non-PCB oil, cleaned up. PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374.
Remarks:	Spill is contained.

All Materials:

Site ID:	327662
Operable Unit ID:	887998
Operable Unit:	01
Material ID:	489188
Material Code:	0020A
Material Name:	transformer oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NIMO BLDG OAKWOOD AVE RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	0405710 / 2004-11-16
Facility ID:	0405710
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327663
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	4217
Spill Date:	2004-08-25
Investigator:	WEBLAIN
Referred To:	Not reported
Reported to Dept:	2004-08-25
CID:	408
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-08-25
Spill Record Last Update:	2012-07-18
Spiller Name:	TOM SULLIVAN
Spiller Company:	NIAGRA[SP]MOHAWK BLD NIMO
Spiller Address:	235 OAKWOOD AVE.
Spiller Company:	001
Contact Name:	TOM SULLIVAN
Latitude:	42.7669450
Longitude:	-73.6610140
DEC Memo:	Factory labeled non-PCB, remediation complete. PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374.
Remarks:	CONTAINED AT THE SITE AND HAZMAT CREW IS ON ITS WAY TO CLEAN IT UP.

All Materials:

Site ID:	327663
Operable Unit ID:	888460
Operable Unit:	01
Material ID:	486517
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NIMO OAKWOOD AVE O/W SEP RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	8708047 / 1988-07-05
Facility ID:	8708047
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327664
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	B3
SWIS:	4217
Spill Date:	1987-12-17
Investigator:	MCDONALD
Referred To:	Not reported
Reported to Dept:	1987-12-17
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	1988-07-05
Cleanup Meets Std:	True
Last Inspection:	1987-12-22
Recommended Penalty:	False

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1987-12-23
Spill Record Last Update:	2012-07-18
Spiller Name:	Not reported
Spiller Company:	NIAGARA MOHAWK NIMO
Spiller Address:	1125 BROADWAY
Spiller Company:	001
Contact Name:	Not reported
Latitude:	42.7997285
Longitude:	-73.6401897
DEC Memo:	PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374.
Remarks:	OIL/WATER SEPARATOR OVERFILLED, SOME TO STORM DRAIN. NIMO TO CLEANUP

All Materials:

Site ID:	327664
Operable Unit ID:	912370
Operable Unit:	01
Material ID:	463443
Material Code:	0015
Material Name:	motor oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Sewer
Oxygenate:	Not reported

Site ID:	327664
Operable Unit ID:	912370
Operable Unit:	01
Material ID:	463444
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	500.00
Units:	G
Recovered:	.00
Resource Affected:	Sewer
Oxygenate:	Not reported

Name:	NIMO MAINT CTR OAKWOOD RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	9206473 / 1992-12-07
Facility ID:	9206473
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327665
DEC Region:	4
Spill Cause:	Other
Spill Class:	C3
SWIS:	4217

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Spill Date:	1992-09-03
Investigator:	WEBLAIN
Referred To:	Not reported
Reported to Dept:	1992-09-03
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	1992-09-03
Cleanup Meets Std:	True
Last Inspection:	1992-09-03
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1992-09-08
Spill Record Last Update:	2012-07-18
Spiller Name:	Not reported
Spiller Company:	NIAGARA MOHAWK NIMO MAIN
Spiller Address:	OAKWOOD AVE RT 40
Spiller Company:	001
Contact Name:	Not reported
Latitude:	42.7997285
Longitude:	-73.6401897
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BLAIN PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374.
Remarks:	FOUND CONT. SOIL FROM LEAKING LIFT CYLINDER, 4-5YDS STOCKPILED. BLAIN @ SITE-MINOR PROBLEM.

All Materials:

Site ID:	327665
Operable Unit ID:	970170
Operable Unit:	01
Material ID:	410634
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NIMO OAKWOOD SERVICE CENTER RT 40
Address:	235 OAKWOOD AVE EXT RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	0607871 / 2007-01-16
Facility ID:	0607871
Facility Type:	ER
DER Facility ID:	321451
Site ID:	371702
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	4217

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Spill Date:	2006-10-11
Investigator:	weblain
Referred To:	Not reported
Reported to Dept:	2006-10-11
CID:	444
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2006-10-11
Spill Record Last Update:	2012-07-18
Spiller Name:	DOUG GNIEWEK
Spiller Company:	OAKWOOD SERVICE CENTER NIMO
Spiller Address:	235 OAKWOOD AVE EXT
Spiller Company:	999
Contact Name:	DOUG GNIEWEK
Latitude:	42.7643613
Longitude:	-73.6581785
DEC Memo:	NIMO reports cleanup completed 10/11. closed PBS 4-429503; see 0607571, etc.
Remarks:	LEAK IN THE DIESEL PUMP AT STATION: IS CONTAINED AND CREW ENROUTE TO CLEAN UP AND REPAIR

All Materials:

Site ID:	371702
Operable Unit ID:	1129459
Operable Unit:	01
Material ID:	2119126
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	2.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NIMO OAKWOOD AVE RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	0607571 / 2006-11-28
Facility ID:	0607571
Facility Type:	ER
DER Facility ID:	321117
Site ID:	371338
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	4217
Spill Date:	2006-10-03
Investigator:	WEBLAIN

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Referred To:	Not reported
Reported to Dept:	2006-10-03
CID:	410
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2006-10-03
Spill Record Last Update:	2012-07-18
Spiller Name:	BARBRA [SP] SCHEURER
Spiller Company:	DRIVEWAY (NIMO)
Spiller Address:	235 OAKWOOD AVE
Spiller Company:	001
Contact Name:	BARBRA [SP] SCHEURER
Latitude:	42.7643613
Longitude:	-73.6581785
DEC Memo:	PBS 4-429503 Minor 1 gal spill. no dec response
Remarks:	SPILL IS LESS THAN ONE GALLON, CONTAINED AND ABSORBENT PADS APPLIED: VALVE ON STORAGE TANK TO BE REPLACED TOMMOROW: 10/04/06

All Materials:

Site ID:	371338
Operable Unit ID:	1129101
Operable Unit:	01
Material ID:	2118764
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	1.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NAT GRID OAKWOOD AVE RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	0811371 / 2009-01-16
Facility ID:	0811371
Facility Type:	ER
DER Facility ID:	345309
Site ID:	408946
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	4217
Spill Date:	2009-01-15
Investigator:	WEBLAIN
Referred To:	Not reported
Reported to Dept:	2009-01-15
CID:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-01-15
Spill Record Last Update:	2012-07-18
Spiller Name:	BARB SCHUERE BARBARA SCHEURER
Spiller Company:	NATIONAL GRID NIMO
Spiller Address:	235 OAKWOOD AVE
Spiller Company:	999
Contact Name:	BARB SCHUERER
Latitude:	42.7643613
Longitude:	-73.6581785
DEC Memo:	minor. closed
Remarks:	CALLER STATES THAT ABOUT A GALLON OF PRODUCT SPILLED TO BLACKTOP, IT IS EITHER HYDRAULIC FLUID OR MOTOR OIL. CLEAN UP IS PENDING.

All Materials:

Site ID:	408946
Operable Unit ID:	1165452
Operable Unit:	01
Material ID:	2156861
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	1.00
Resource Affected:	Not reported
Oxygenate:	Not reported

Click this hyperlink while viewing on your computer to access
17 additional NY SPILL: record(s) in the EDR Site Report.

NY MANIFEST:

EPA ID:	NYD980788442
Country:	USA
Name:	NIAGARA MOHAWK POWER CORP
Address:	235 OAKWOOD AVE. EXT.
Address 2:	Not reported
City,State,Zip:	TROY, NY 13202-4298
Zip 4:	Not reported
Location Address 1:	235 OAKWOOD AVE
Location Address 2:	Not reported
Location City,State,Zip:	TROY, NY 12182
Location Zip 4:	1600
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Mailing:

Mailing Name:	NIAGARA MOHAWK POWER CORP
Mailing Contact:	NIAGARA MOHAWK POWER CORP
Mailing Address 1:	1125 BROADWAY
Mailing Address 2:	Not reported
Mailing City,State,Zip:	ALBANY, NY 12204
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	5184713502

Manifest Data:

Document ID:	NYC3140436
Manifest Status:	Not reported
Trans1 State ID:	NYRH6932
Year:	1994
Trans2 State ID:	Not reported
Generator Ship Date:	07/22/1994
Trans1 Recv Date:	07/22/1994
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/22/1994
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD986872869
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00008
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	IGNITABLE WASTE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Quantity: 00005
Units: Gallons (liquids only)
Number of Containers: 001
Container Type: Fiberboard or plastic drums, barrels, kegs
Handling Method: Recycle
Specific Gravity: 01.00

Document ID: NYG2923641
Manifest Status: Not reported
Trans1 State ID: TPZ409NJ
Year: 2001
Trans2 State ID: Not reported
Generator Ship Date: 10/15/2001
Trans1 Recv Date: 10/15/2001
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/22/2001
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD980788442
Trans1 EPA ID: NJD071629976
Trans2 EPA ID: Not reported
TSDF ID 1: PAD981113749
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: B004
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 01142
Units: Kilograms
Number of Containers: 006
Container Type: Metal boxes, cartons, cases (including roll-offs)
Handling Method: Recycle
Specific Gravity: 01.00

Document ID: NYG2907558
Manifest Status: Not reported
Trans1 State ID: 0726992ME
Year: 2001
Trans2 State ID: Not reported
Generator Ship Date: 04/27/2001
Trans1 Recv Date: 04/27/2001
Trans2 Recv Date: Not reported
TSD Site Recv Date: 05/04/2001

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	NYD986899912
Trans2 EPA ID:	Not reported
TSDF ID 1:	ALD983167891
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B006
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00136
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYC1837293
Manifest Status:	Not reported
Trans1 State ID:	NYEC2076
Year:	1992
Trans2 State ID:	Not reported
Generator Ship Date:	08/14/1992
Trans1 Recv Date:	08/14/1992
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/14/1992
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD986872869
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00045
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	IGNITABLE WASTE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00027
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYC2254454
Manifest Status:	Not reported
Trans1 State ID:	NYIM5676
Year:	1993
Trans2 State ID:	Not reported
Generator Ship Date:	05/04/1993
Trans1 Recv Date:	05/04/1993
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/04/1993
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD986872869
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00008
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	IGNITABLE WASTE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYB4020552
Manifest Status:	Not reported
Trans1 State ID:	PB9830NY
Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	06/05/1997
Trans1 Recv Date:	06/05/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/05/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	NYD980769947
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD000730408
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	MERCURY
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00499

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Units:	Pounds
Number of Containers:	003
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	01.00
Waste Code 7:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00091
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYC2313933
Manifest Status:	Not reported
Trans1 State ID:	NYIM5676
Year:	1993
Trans2 State ID:	Not reported
Generator Ship Date:	05/27/1993
Trans1 Recv Date:	05/27/1993
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/27/1993
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD986872869
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00008
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	IGNITABLE WASTE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYC3364345
Manifest Status:	Not reported
Trans1 State ID:	NYGS7503
Year:	1994
Trans2 State ID:	Not reported
Generator Ship Date:	12/06/1994
Trans1 Recv Date:	12/06/1994
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/06/1994
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD986872869
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00008
Units:	Gallons (liquids only)

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	IGNITABLE WASTE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYC1888367
Manifest Status:	Not reported
Trans1 State ID:	NYGS7503
Year:	1992
Trans2 State ID:	Not reported
Generator Ship Date:	10/12/1992
Trans1 Recv Date:	10/12/1992
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/12/1992
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD986872869
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00045
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	IGNITABLE WASTE

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00027
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYG2442537
Manifest Status:	Not reported
Trans1 State ID:	AA709F
Year:	2000
Trans2 State ID:	Not reported
Generator Ship Date:	11/07/2000
Trans1 Recv Date:	11/07/2000
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/08/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	NJD071629976
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD981113749
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B004
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00345
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYG2442555
Manifest Status:	Not reported
Trans1 State ID:	AA709F
Year:	2000
Trans2 State ID:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Generator Ship Date:	09/26/2000
Trans1 Recv Date:	09/26/2000
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/03/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	NJD071629978
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD981113749
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B004
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00937
Units:	Kilograms
Number of Containers:	004
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	B004
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00205
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Click this hyperlink while viewing on your computer to access
105 additional NY MANIFEST: record(s) in the EDR Site Report.

O80 **NIAGARA MOHAWK A NATIONAL GRID CO-MANHOLE 7-4** **RCRA NonGen / NLR** **1014957328**
North **400 HARRISON ST** **NY MANIFEST** **NYP000968313**
1/8-1/4 **SYRACUSE, NY 13202**
0.184 mi.
974 ft. **Site 1 of 3 in cluster O**

Relative: **Lower**

Actual: **395 ft.**

RCRA Listings:

Date Form Received by Agency:	20120927
Handler Name:	Niagara Mohawk A National Grid Co-Manhole 7-4
Handler Address:	Harrison St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYP000968313
Contact Name:	MARGARET M CARD
Contact Address:	ERIE BLVD W
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-428-6670
Contact Fax:	315-460-8388
Contact Email:	Not reported
Contact Title:	SR ENVIRONMENTAL ANALYST
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	ERIE BLVD W
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No

NIAGARA MOHAWK A NATIONAL GRID CO-MANHOLE 7-4 (Continued) **1014957328**

Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20170512
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	20120514
Handler Name:	NIAGARA MOHAWK A NATIONAL GRID CO
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20120927
Handler Name:	NIAGARA MOHAWK A NATIONAL GRID CO-MANHOLE 7-4
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Codes:	No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

NIAGARA MOHAWK A NATIONAL GRID CO-MANHOLE 7-4 (Continued) **1014957328**

NY MANIFEST:

EPA ID:	NYP000968313
Country:	USA
Name:	NIAGARA MOHAWK A NATIONAL GRID CO
Address:	400 HARRISON ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	400 HARRISON ST MANHOLE 7-4
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	NIAGARA MOHAWK A NATIONAL GRID CO
Mailing Contact:	NIAGARA MOHAWK A NATIONAL GRID CO
Mailing Address 1:	400 HARRISON ST MANHOLE 7-4
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	Not reported

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	06/04/2012
Trans1 Recv Date:	06/05/2012
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/15/2012
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP000968313
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	004945947FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	B002
Waste Code b:	B007

NIAGARA MOHAWK A NATIONAL GRID CO-MANHOLE 7-4 (Continued) **1014957328**

Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	23
Units:	Kilograms
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1

P81 **SYRACUSE HOUSING AUTH - PIONEER HOMES BLDG 60** **RCRA-VSQG** **1012186551**
East **101-102 DYER COURT** **NYR000164129**
1/8-1/4 **SYRACUSE, NY 13202**
0.187 mi.
987 ft. **Site 1 of 2 in cluster P**

Relative: **Higher**

Actual: **407 ft.**

RCRA Listings:

Date Form Received by Agency:	20090415
Handler Name:	Syracuse Housing Auth - Pioneer Homes Bldg 60
Handler Address:	Dyer Court
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYR000164129
Contact Name:	WILLIAM W GEHRKE
Contact Address:	BURT ST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-470-4315
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Other
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	DYER COURT
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Syracuse Housing Authority
Owner Type:	Other
Operator Name:	Syracuse Housing Authority
Operator Type:	Other
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No

SYRACUSE HOUSING AUTH - PIONEER HOMES BLDG 60 (Continued) **1012186551**

Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY	
Legal Status:	Other
Date Became Current:	19540101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY	
Legal Status:	Other
Date Became Current:	19540101
Date Ended Current:	Not reported
Owner/Operator Address:	516 BURT ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	Not reported

SYRACUSE HOUSING AUTH - PIONEER HOMES BLDG 60 (Continued) **1012186551**

Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20090415
Handler Name: SYRACUSE HOUSING AUTH - PIONEER HOMES BLDG 60
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 92511
NAICS Description: ADMINISTRATION OF HOUSING PROGRAMS

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Q82 **CENTRAL GARAGE** **UST FINDER** **1028589371**
NNE **700-712 S. TOWNSEND ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.188 mi.
990 ft. **Site 1 of 2 in cluster Q**

Relative:
Higher

Actual:
398 ft.

UST FINDER:
Object ID: 318338
Facility ID: NY45567
Name: CENTRAL GARAGE
Address: 700-712 S. TOWNSEND ST
City,State,Zip: SYRACUSE, NY 13202
Address Match Type: Not reported
Open USTs: 2
Closed USTs: 2
TOS USTs: 0
Population 1500ft: 2016
Private Wells 1500ft: 0
Within 100yr Floodplain: No
Land Use: Developed, Medium Intensity
Within SPA: No
SPA PWS Facility ID: Not reported
SPA Water Type: Not reported
SPA Facility Type: Not reported
SPA HUC12: Not reported
Within WHPA: No
WHPA PWS Facility ID: Not reported

CENTRAL GARAGE (Continued) **1028589371**

WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Open UST(s)
Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.145292
Y Coord:	43.0451820000001
Latitude:	43.045182
Longitude:	-76.145292

UST FINDER:

Object ID:	1280598
Facility ID:	NY45567
Tank ID:	NY72121
Tank Status:	Closed
Installation Date:	1978/08/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	8000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1280599
Facility ID:	NY45567
Tank ID:	NY81247
Tank Status:	Closed
Installation Date:	1978/08/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	8000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1280600
Facility ID:	NY45567
Tank ID:	NY75693
Tank Status:	Open
Installation Date:	1962/06/01 16:00:01+00
Removal Date:	Not reported
Tank Capacity:	500
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1280601
Facility ID:	NY45567
Tank ID:	NY118196
Tank Status:	Open
Installation Date:	1962/06/01 16:00:01+00
Removal Date:	Not reported
Tank Capacity:	500
Substances:	Not reported
Tank Wall Type:	Not reported

Q83 **CENTRAL GARAGE** **NY UST** **U003313404**
NNE **700-712 S. TOWNSEND ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.188 mi.
990 ft. **Site 2 of 2 in cluster Q**

Relative:
Higher

Actual:
398 ft.

UST:

Name:	CENTRAL GARAGE
Address:	700-712 S. TOWNSEND ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-394289 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	406715.32823
UTM Y:	4766415.96197
Site Type:	Other

Affiliation Records:

Site Id:	45567
Affiliation Type:	Mail Contact
Company Name:	ONONDAGA COUNTY FACILITIES MANAGEMENT
Contact Type:	Not reported
Contact Name:	JOHN M. ELLIOTT
Address1:	600 S. STATE ST.
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 435-3451
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45567
Affiliation Type:	Facility Owner
Company Name:	ONONDAGA COUNTY FACILITIES MANAGEMENT
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	600 S. STATE ST.
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 435-3451
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45567
Affiliation Type:	Facility Operator
Company Name:	CENTRAL GARAGE
Contact Type:	Not reported
Contact Name:	FRANK HANSON
Address1:	Not reported

CENTRAL GARAGE (Continued) **U003313404**

Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 435-2246
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45567
Affiliation Type:	Emergency Contact
Company Name:	ONONDAGA COUNTY FACILITIES MANAGEMENT
Contact Type:	Not reported
Contact Name:	CONTROL ROOM SUPERVISOR
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 435-2284
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Tank Info:

Tank Number:	003
Tank ID:	131241
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	8000
Install Date:	08/01/1978
Date Tank Closed:	10/01/1994
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline

Tightness Test Method:	11
Date Test:	12/01/1993
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
C02 - Pipe Location - Underground/On-ground

CENTRAL GARAGE (Continued) **U003313404**

G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number:	004
Tank ID:	131242
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	8000
Install Date:	08/01/1978
Date Tank Closed:	10/01/1994
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	11
Date Test:	12/01/1993
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser

Tank Number:	190
Tank ID:	135640
Tank Status:	Tank Converted to Non-Regulated Use
Material Name:	Tank Converted to Non-Regulated Use
Capacity Gallons:	500
Install Date:	06/01/1962
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	03
Date Test:	09/01/1997
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

CENTRAL GARAGE (Continued) **U003313404**

G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
J00 - Dispenser - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number:	378
Tank ID:	138207
Tank Status:	Tank Converted to Non-Regulated Use
Material Name:	Tank Converted to Non-Regulated Use
Capacity Gallons:	500
Install Date:	06/01/1962
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	03
Date Test:	09/01/1997
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
J00 - Dispenser - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None

O84 **NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 8-2** **NY MANIFEST** **S120957737**
North **S STATE ST & HARRISON ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13367**
0.188 mi.
993 ft. **Site 2 of 3 in cluster O**

Relative: NY MANIFEST:
Lower

Actual: EPA ID:	NYP000973675
395 ft. Country:	USA
Name:	NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 8-2
Address:	S STATE ST & HARRISON ST
Address 2:	MH 8-2
City,State,Zip:	SYRACUSE, NY 13367
Zip 4:	Not reported
Location Address 1:	S STATE ST & HARRISON ST MH 8-2
Location Address 2:	Not reported

NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 8-2 (Continued) **S120957737**

Location City,State,Zip:	SYRACUSE, NY 13367
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 8-2
Mailing Contact:	NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 8-2
Mailing Address 1:	S STATE ST & HARRISON ST MH 8-2
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13367
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	Not reported

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	05/05/2017
Trans1 Recv Date:	05/05/2017
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/07/2017
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP000973675
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	004941073FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	LEAD
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported

NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 8-2 (Continued) **S120957737**

Quantity:	875
Units:	Pounds
Number of Containers:	5
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	1

O85 **NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 8-2** **RCRA NonGen / NLR** **1023678994**
North **S STATE ST & HARRISON ST** **NYP000973675**
1/8-1/4 **SYRACUSE, NY 13367**
0.188 mi.
993 ft. **Site 3 of 3 in cluster O**

Relative: **Lower**
Actual: **395 ft.**

RCRA Listings:

Date Form Received by Agency:	20170616
Handler Name:	Niagara Mohawk A National Grid Co Manhole 8-2
Handler Address:	S State St & Harrison St
Handler City,State,Zip:	SYRACUSE, NY 13367
EPA ID:	NYP000973675
Contact Name:	LENNY DELVECCHIO
Contact Address:	ERIE BLVD W
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-428-6670
Contact Fax:	315-460-8388
Contact Email:	Not reported
Contact Title:	ENVIRONMENTAL ANALYST
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	ERIE BLVD W
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N

NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 8-2 (Continued) **1023678994**

Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20170626
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D008
Waste Description:	Lead

Historic Generators:

Receive Date:	20170511
Handler Name:	NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 8-2
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20170616
Handler Name:	NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 8-2
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 8-2 (Continued) **1023678994**

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

R86 **PROJECT ORANGE** **NY CBS** **1000790137**
ESE **520 E TAYLOR ST** **NY AST** **NYD987016136**
1/8-1/4 **SYRACUSE, NY 13202** **NY CBS AST**
0.194 mi. **NY Spills**
1022 ft. **Site 1 of 3 in cluster R** **RCRA NonGen / NLR**
NY AIRS
Relative: Higher **NY MANIFEST**

Actual: 408 ft.

CBS:
Name: PROJECT ORANGE
Address: 520 EAST TAYLOR STREET
City,State,Zip: SYRACUSE, NY 13202
CBS Number: 7-000230
Program Type: CBS
Facility Status: Unregulated/Closed
Expiration Date: Not reported
Dec Region: 7
UTMX: 406845.00000
UTMY: 4765829.00000

AST:
Name: PROJECT ORANGE
Address: 520 EAST TAYLOR STREET
City,State,Zip: SYRACUSE, NY 13202
Region: STATE
DEC Region: 7
Site Status: Unregulated/Closed
Facility Id: 7-000230
Program Type: CBS
UTM X: 406845.00000
UTM Y: 4765829.00000
Expiration Date: N/A
Site Type: Utility (Other than Municipal)

Tank Info:

Tank Number: T-100
Tank Id: 190104
Tank Location: Aboveground - contact with impervious barrier... Tank bottom rests on impervious barrier, allowing visual indication of leaks.
Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 04/01/1992
Capacity Gallons: 7000
Tightness Test Method: NN

PROJECT ORANGE (Continued) **1000790137**

Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 01/17/2011
Register: True
Modified By: MJGRIFFI
Last Modified: 05/09/2022
Material Name: Not reported

Tank Number: T-200
Tank Id: 190105
Tank Location: Aboveground - contact with impervious barrier... Tank bottom rests on impervious barrier, allowing visual indication of leaks.
Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 04/01/1992
Capacity Gallons: 7000
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 01/17/2011
Register: True
Modified By: MJGRIFFI
Last Modified: 05/09/2022
Material Name: Not reported

CBS AST:
CBS Number: 7-000230
ICS Number: Not reported
PBS Number: Not reported
MOSF Number: Not reported
SPDES Number: Not reported
Facility Status: IN SERVICE
Facility Type: I
Telephone: (315) 474-8230
Facility Town: SYRACUSE (C)
Region: STATE
Expiration Date: 04/29/2002
Total Capacity of All Active Tanks(gal): 14000
Operator: GENERAL ELECTRIC
Emergency Contact: JEFF GUYSKY
Emergency Phone: (315) 474-8230
Owner Name: PROJECT ORANGE ASSOCIATES, L.P.
Owner Address: 507 PLUM STREET
Owner City,St,Zip: SYRACUSE, NY 13204
Owner Telephone: (315) 460-3379
Owner Type: Corporate/Commercial
Owner Sub Type: Not reported
Mail Name: NIAGARA MOHAWK ENERGY
Mail Contact Addr: 507 PLUM STREET
Mail Contact Addr2: Not reported
Mail Contact Contact: JAMES C. FARATTA
Mail Contact City,St,Zip: SYRACUSE, NY 13204
Mail Phone: (315) 460-3379

Tank Id: T-200

PROJECT ORANGE (Continued) **1000790137**

CAS Number:	1310732
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	04/92
Tank Closed:	Not reported
Capacity (Gal):	7000
Chemical:	Sodium hydroxide
Tank Location:	Indoors, Aboveground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	04/28/1992
Certified Date:	02/08/2000
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	Epoxy Liner
External Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Pipe Flag:	Painted/Asphalt Coating
Leak Detection:	None
Overfill Protection:	54
Haz Percent:	50
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	76|08|36 / 43|02|59
Is Updated:	False
Renew Date:	/ /
Is It There:	False
Delinquent:	False
Date Expired:	04/29/94
Owner Mark:	1
Certificate Needs to be Printed:	76|08|36 / 43|02|59
Fiscal Amt for Registration Fee Correct:	76|08|36 / 43|02|59
Renewal Has Been Printed for Facility:	76|08|36 / 43|02|59
Pre-Printed Renewal App Last Printed:	76|08|36 / 43|02|59

Tank Id:	T-100
CAS Number:	7664939
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	04/92
Tank Closed:	Not reported
Capacity (Gal):	7000
Chemical:	Sulfuric acid
Tank Location:	Indoors, Aboveground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	04/28/1992

PROJECT ORANGE (Continued) **1000790137**

Certified Date:	02/08/2000
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	Other
External Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Pipe Flag:	Painted/Asphalt Coating
Leak Detection:	None
Overfill Protection:	54
Haz Percent:	93
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	76|08|36 / 43|02|59
Is Updated:	False
Renew Date:	/ /
Is It There:	False
Delinquent:	False
Date Expired:	04/29/94
Owner Mark:	1
Certificate Needs to be Printed:	76|08|36 / 43|02|59
Fiscal Amt for Registration Fee Correct:	76|08|36 / 43|02|59
Renewal Has Been Printed for Facility:	76|08|36 / 43|02|59
Pre-Printed Renewal App Last Printed:	76|08|36 / 43|02|59

SPILLS:

Name:	520 E.TAYLOR ST.
Address:	520 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9211857 / 1993-03-02
Facility ID:	9211857
Facility Type:	ER
DER Facility ID:	184663
Site ID:	212315
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	B3
SWIS:	3415
Spill Date:	1993-01-16
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1993-01-17
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	1993-03-02
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1993-01-19
Spill Record Last Update:	1993-03-02
Spiller Name:	Not reported

PROJECT ORANGE (Continued) **1000790137**

Spiller Company:	STEWART AND STEVENSON OP.
Spiller Address:	520 E.TAYLOR ST.
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0394313
Longitude:	-76.1434802
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 01/19/93: ALLWASH HIRED TO WIPE DOWN EQUIPMENT SURROUNDING TRANSFORMER.
Remarks:	TRNSFORMER EXPLODED. OIL IN UNIT VAPORIZED AND BURNED.

All Materials:

Site ID:	212315
Operable Unit ID:	976296
Operable Unit:	01
Material ID:	405241
Material Code:	0016A
Material Name:	non PCB oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	35.00
Units:	G
Recovered:	1.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	PROJECT ORANGE CO-GEN
Address:	520 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0001904 / 2002-06-03
Facility ID:	0001904
Facility Type:	ER
DER Facility ID:	184663
Site ID:	223336
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	3415
Spill Date:	2000-05-15
Investigator:	CXROSSI
Referred To:	Not reported
Reported to Dept:	2000-05-15
CID:	397
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	2000-05-15
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2000-05-15
Spill Record Last Update:	2002-06-03
Spiller Name:	JAMES MCCUMBER
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	029 LYMAN HALL

PROJECT ORANGE (Continued) **1000790137**

Spiller Company:	001
Contact Name:	CALLER
Latitude:	43.0394313
Longitude:	-76.1434802
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CTR
Remarks:	caller states his company has found fuel oil on thier property. caller would like a call to give specific location of spill

All Materials:

Site ID:	223336
Operable Unit ID:	823585
Operable Unit:	01
Material ID:	550288
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	SYRACUSE UNIVERSITY STEAM STATION
Address:	520 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1213761 / 2013-01-09
Facility ID:	1213761
Facility Type:	ER
DER Facility ID:	432291
Site ID:	476969
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	A3
SWIS:	3415
Spill Date:	2012-12-20
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2012-12-20
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	2012-12-20
Cleanup Meets Std:	False
Last Inspection:	2012-12-20
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2012-12-20
Spill Record Last Update:	2013-01-10
Spiller Name:	Not reported
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	JAMES MCCUMBER
Latitude:	43.0394042

PROJECT ORANGE (Continued) **1000790137**

Longitude:	-76.1435330
DEC Memo:	12/20/2012 - Approx 1 gallon of 50% sulfuric acid released onto worker after flexible poly pipe burst, spraying area and worker. Worker immediately placed under water deluge shower, all clothing removed, and eyes rinsed. Approx 1 gallon of sulfuric acid flowed from water deluge area into nearby sanitary sewer. Site is not CBS regulated due to small bulk tank sizes (< 185 gallons), but chemical sulfuraic acid chemical is listed in part 597, so WEP and SU contacted hotline and Fire Department. FD and plant personnel placed sodium bicarb over acid sprayed to floor as well as into sewer in attmept to neutralize acid. Brazell notified for possible municipal notifcation requirement. KCKemp 1/9/2013 - Closure report received and filed. KCKemp
Remarks:	1 gallon possibly into floor drain - FD on scene now -

All Materials:

Site ID:	476969
Operable Unit ID:	1226782
Operable Unit:	01
Material ID:	2224144
Material Code:	0039A
Material Name:	sulfuric acid
Case No.:	07664939
Material FA:	Hazardous Material
Quantity:	1.00
Units:	G
Recovered:	.00
Resource Affected:	Sewer, Impervious Surface
Oxygenate:	Not reported

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	Project Orange
Handler Address:	E Taylor St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYD987016136
Contact Name:	TRACY JONES
Contact Address:	E TAYLOR ST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-474-8230
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7

PROJECT ORANGE (Continued) **1000790137**

Mailing Address:	E TAYLOR ST
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Project Orange Associates Lp
Owner Type:	Private
Operator Name:	Project Orange Associates Lp
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D002
Waste Description:	Corrosive Waste

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	PROJECT ORANGE ASSOCIATES LP
Legal Status:	Private

PROJECT ORANGE (Continued) **1000790137**

Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 1100 TOWN & COUNTRY RD STE 800
Owner/Operator City,State,Zip: ORANGE, CA 92668
Owner/Operator Telephone: 714-667-3800
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: PROJECT ORANGE ASSOCIATES LP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 1100 TOWN & COUNTRY RD STE 800
Owner/Operator City,State,Zip: ORANGE, CA 92668
Owner/Operator Telephone: 714-667-3800
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: PROJECT ORANGE ASSOCIATES LP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 1100 TOWN & COUNTRY RD STE 800
Owner/Operator City,State,Zip: ORANGE, CA 92668
Owner/Operator Telephone: 714-667-3800
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20060101
Handler Name: PROJECT ORANGE
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: PROJECT ORANGE
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes

PROJECT ORANGE (Continued) **1000790137**

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920928
Handler Name: PROJECT ORANGE
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19960226
Handler Name: STEWART & STEVENSON OPERATIONS, INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 2211
NAICS Description: ELECTRIC POWER GENERATION, TRANSMISSION AND DISTRIBUTION

NAICS Code: 22111
NAICS Description: ELECTRIC POWER GENERATION

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

AIRS:
Name: PROJECT ORANGE ASSOCIATES
Address: 520 E TAYLOR ST
City,State,Zip: SYRACUSE, NY 13202
DECID: 7311500229
Process ID: Not reported
Latitude: 43.039269803
Longitude: 76.143428112
FIPS Code: Not reported
Auth Type Code: ATV

Permit Status: Expired

PROJECT ORANGE (Continued) **1000790137**

Auth Status Code:	Not reported
Emissions:	Not reported
Issue date:	02/24/2003
Expired Date:	12/04/2005
Emission Unit date:	Not reported
Contamination:	Not reported
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	Not reported

Permit Status:	Expired
Auth Status Code:	Not reported
Emissions:	Not reported
Issue date:	12/29/2006
Expired Date:	06/27/2011
Emission Unit date:	Not reported
Contamination:	Not reported
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	Not reported

Permit Status:	Expired
Auth Status Code:	Not reported
Emissions:	Not reported
Issue date:	06/27/2011
Expired Date:	Not reported
Emission Unit date:	Not reported
Contamination:	Not reported
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	Not reported

Permit Status:	Expired
Auth Status Code:	Not reported
Emissions:	Not reported
Issue date:	12/04/2000
Expired Date:	12/04/2005
Emission Unit date:	Not reported
Contamination:	Not reported
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	Not reported

Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.0013
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	EI0001
Contamination:	1330207
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	LB

Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.0071

PROJECT ORANGE (Continued) **1000790137**

Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	EI0001
Contamination:	108883
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	LB
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.00000085
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	UP0001
Contamination:	SO2
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	TON
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	UP0001
Contamination:	7440382
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	LB
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	UP0002
Contamination:	207089
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	LB
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	UP0002
Contamination:	205992
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	LB
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.0028
Issue date:	Not reported
Expired Date:	Not reported

PROJECT ORANGE (Continued) **1000790137**

Emission Unit date: US0067
Contamination: 7440417
EPA Control Code: Not reported
Control Eff: Not reported
Unit: LB

AIRS Detail:
DECID: 7311500229
Facility Name: PROJECT ORANGE ASSOCIATES
Auth Type: Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 168.45504

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 142538880

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 36070

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount(Lbs/Yr): 82.931712000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 726

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 8552.3328000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075105

PROJECT ORANGE (Continued) **1000790137**

Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 34147.667200000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 76900

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 2561.62834496

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount(Lbs/Yr): 43.586129999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount(Lbs/Yr): 0.64627710000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000107028
Contaminant: ACROLEIN
Amount(Lbs/Yr): 9.6190079999999991

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 196.23995041932

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 652.944438303845

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000110543
Contaminant: HEXANE

PROJECT ORANGE (Continued) **1000790137**

Amount(Lbs/Yr): 452.03845728727703

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 1.2208364547253801E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 226562700

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 2.5434092806778702E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 6.1041822736268797E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 9.1562734104403201E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 1.5260455684067201E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 4.5203845728727699E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 4.5203845728727699E-4

PROJECT ORANGE (Continued) **1000790137**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 23875.790000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount(Lbs/Yr): 96.190079999999995

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.25434092806778702

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.19329910533151801

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 0.13225728259524899

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.55955004174913103

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 1.0682318978847001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.101736371227115

Issue Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Expiration Date: Not reported
Year: 2009
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 2.2382001669965201

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 6.1041822736268804E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.55955004174913103

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.71215459858980301

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 0.0427292759153882

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.432379577715237

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 1.1699682691118201

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 14.751773827931601

Issue Date: Not reported
Expiration Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Year: 2009
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 1133.5

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 1632.96

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 1.2208364547253801E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 1122.6600000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.30135897152485103

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 13785.5841066304

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 45637.180044799999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 1085.9436357203001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009

PROJECT ORANGE (Continued) **1000790137**

CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.0135897152485102E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.0135897152485102E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 4.5203845728727699E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 18.5630182001685

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 14099.232

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 1581.9300000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 401.81196203313499

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount(Lbs/Yr): 60.1188

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000083329

PROJECT ORANGE (Continued) **1000790137**

Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 9.1562734104403201E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 0.00426925209660206

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 0.00142430919717961

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 2.1070518105251299

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 1.2208364547253801E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount(Lbs/Yr): 48.095039999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 155981

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 2974.3603638999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000106978
Contaminant: BUTANE

PROJECT ORANGE (Continued) **1000790137**

Amount(Lbs/Yr): 527.37820016849003

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 920.02368000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 15.549696000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 11143.9488

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount(Lbs/Yr): 51.832320000000003

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount(Lbs/Yr): 37.578431999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 1.6845504

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount(Lbs/Yr): 41.465856000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount(Lbs/Yr): 0.55719744000000004

PROJECT ORANGE (Continued) **1000790137**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000107028
Contaminant: ACROLEIN
Amount(Lbs/Yr): 8.2931711999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.87182945748297402

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000107028
Contaminant: ACROLEIN
Amount(Lbs/Yr): 15.9126528

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 216406.70000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 2.6662342378036299

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 1.4543095842565301E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 22779.4172

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 463.367741931068

Issue Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Expiration Date: Not reported
Year: 2008
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 5.41082641931068E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 3.0298116338677702E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 0.00169669451496595

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 1.0907321881924001E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.667173569450908

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007446119
Contaminant: SULFUR TRIOXIDE
Amount(Lbs/Yr): 478.03050000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 21029.214383479

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 1.2735272662244601

Issue Date: Not reported
Expiration Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Year: 2008
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 21727.349999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.56745564775752

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 324.101010179203

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 7.2715479212826395E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 17.573131116433

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount(Lbs/Yr): 1.0691313600000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 346374720

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 3.4079058092099701

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008

PROJECT ORANGE (Continued) **1000790137**

CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 1988.088

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 1.0907321881924001E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 1882.6300000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.30891182795404598

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.12142728735471101

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.66655855945090803

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount(Lbs/Yr): 99.454080000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 4.6336774193106803E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000050000

PROJECT ORANGE (Continued) **1000790137**

Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 1787.3005892471299

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.0891182795404602E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.37342776338677702

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 7.4113229212826402E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount(Lbs/Yr): 159.12652800000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 4929.6454707966004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 1.9721985803206601E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 4.3762508960156496E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007439976
Contaminant: MERCURY

PROJECT ORANGE (Continued) **1000790137**

Amount(Lbs/Yr): 0.15771793496112399

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount(Lbs/Yr): 72.104208

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 540.59569891957995

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 1350.5966000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 1.4543095842565299E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 5.0900835448978499E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 411.882437272061

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 1.39371335157917

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 669.30896056709901

PROJECT ORANGE (Continued) **1000790137**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007782505
Contaminant: CHLORINE
Amount(Lbs/Yr): 0.24097209999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 75418.799396311399

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.83831227954046E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount(Lbs/Yr): 79.563264000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 17522.873599999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 5.1614684193106804E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.23104842417395

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 30.376819698919601

Issue Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Expiration Date: Not reported
Year: 2008
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 5.2058705842565299E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 5.2060812764591303E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007782505
Contaminant: CHLORINE
Amount(Lbs/Yr): 6.4218999999999998E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 1.6632189650108999E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 1315.2940000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 28098.759999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount(Lbs/Yr): 176.693376

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount(Lbs/Yr): 80.064186000000007

Issue Date: Not reported
Expiration Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Year: 2007
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 1.8231443196545401E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000107028
Contaminant: ACROLEIN
Amount(Lbs/Yr): 17.669337599999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 375223740

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 1919.4400000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 7.1280812786181401E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 462.76278012970101

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 5.3467372764591395E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.65340745053999705

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007

PROJECT ORANGE (Continued) **1000790137**

CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount(Lbs/Yr): 110.43335999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 7.1653312786181403E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007446119
Contaminant: SULFUR TRIOXIDE
Amount(Lbs/Yr): 127.395

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 359.891790907776

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 1.0692121917927201E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount(Lbs/Yr): 1.1871586199999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 5472.0460251373997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 0.154486461036727

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440484

PROJECT ORANGE (Continued) **1000790137**

Contaminant: COBALT
Amount(Lbs/Yr): 0.049896568950327

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 80091.310262045998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 607.37614892023203

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.83786748250544996

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.31577738660908899

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 1.36621557840181

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 1847.9100000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 0.00142561625572363

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000110543
Contaminant: HEXANE

PROJECT ORANGE (Continued) **1000790137**

Amount(Lbs/Yr): 520.60812764591299

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.51886705723545201

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 0.0142561625572363

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.4707208509727599E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.6703808509727599E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.65357135053999604

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 2.9700338660908899E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.118863934643636

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 1.2476824237581801

PROJECT ORANGE (Continued) **1000790137**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 4.9168545388780698E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 22739.680876458198

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 10981.7752

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 2.4254062557236299E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 33.737384148920199

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 17.226256023327199

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount(Lbs/Yr): 88.346688

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 5.4131912764591398E-4

Issue Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Expiration Date: Not reported
Year: 2007
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 2.61362980215999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.225931173822908

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 1982.5993453185799

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 751.98951771076395

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 25114.202399999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.347072085097276

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 225074

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 1.0692121917927201E-3

Issue Date: Not reported
Expiration Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Year: 2007
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 3.7704742099244499

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount(Lbs/Yr): 121.16444568

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.39467390386135998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 14638.74

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 1114.45

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 540.66475011508896

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 374.30636546429298

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 4.5439706966693801E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006

PROJECT ORANGE (Continued) **1000790137**

CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.75339669191714198

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 8.6053333933387693E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount(Lbs/Yr): 1.3025060340000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.39441111386136002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 223112.17999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 4.0782545782962298

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000107028
Contaminant: ACROLEIN
Amount(Lbs/Yr): 19.386478312000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000115071
Contaminant: PROPYLENE
Amount(Lbs/Yr): 0.121086

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000085018

PROJECT ORANGE (Continued) **1000790137**

Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 5.3058356738294298E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 797.1114

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 2167.3957408210099

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 3.0118666876685699E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 1.5594755625561901E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 2.9270397697619499E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 9016.7028232839002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 4.7391546546429302E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000074986
Contaminant: PROPANE

PROJECT ORANGE (Continued) **1000790137**

Amount(Lbs/Yr): 332.71676930159299

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.51201158127809498

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 2.6455397697619498E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount(Lbs/Yr): 87.8434302

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 9.1391533933387703E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 6.9357400450040805E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 2.4635523393338798E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 7058.6509999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 4.2385336546429302E-4

PROJECT ORANGE (Continued) **1000790137**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 1.9537917902789099E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 1169.5119999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 85081.554784946202

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 10.398206743617701

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 436.69075970834098

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 376346224

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 3.8376756546429298E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount(Lbs/Yr): 96.9306816

Issue Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Expiration Date: Not reported
Year: 2006
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 9.3296115094503307E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.82467778352829901

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007446119
Contaminant: SULFUR TRIOXIDE
Amount(Lbs/Yr): 204.2595

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.20937917902789099

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 1.3165050741673499E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 26925.144680000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.249537576976195

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount(Lbs/Yr): 193.86973939999999

Issue Date: Not reported
Expiration Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Year: 2006
CAS #: 007782505
Contaminant: CHLORINE
Amount(Lbs/Yr): 0.1029659

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 22725.288321224001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.13658557206119701

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 36.819374759708403

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 8.4851200450040802E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 1.5776444554454401

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 394.500112534766

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 4.3623916966693804E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006

PROJECT ORANGE (Continued) **1000790137**

CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.32715715434741499

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 7.1811449611156403E-2

AIRS Emissions:
County: ONONDAGA
Municipality: SYRACUSE
Facility ID: 7311500229
Facility Name: PROJECT ORANGE ASSOCIATES
SIC Code: 4931

Year: 2015
VOC(tons): 0
NOx(tons): 0
Co(tons): 0
Co2(tons): 0
Particulates: 0
PM10(tons): 0
PM2.5(tons): 0
HAPS: 0
So2: 0

Year: 2010
VOC(tons): 1.95
NOx(tons): 38.45
Co(tons): 18.04
Co2(tons): 75804.77
Particulates: 21.35
PM10(tons): 21.35
PM2.5(tons): 4.28
HAPS: 0
So2: 0.36

Click this hyperlink while viewing on your computer to access
217 additional NY AIRS: record(s) in the EDR Site Report.

NY MANIFEST:
EPA ID: NYD987016136
Country: USA
Name: PROJECT ORANGE ASSOC LLC
Address: 520 E TAYLOR ST
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported
Location Address 1: 520 EAST TAYLOR STREET
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202
Location Zip 4: Not reported
Facility Status: Not reported

PROJECT ORANGE (Continued) **1000790137**

Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: PROJECT ORANGE ASSOC LLC
Mailing Contact: JOSEPH E MURPHY
Mailing Address 1: 434 E BRIGHTON AVE
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13210
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154748230

Manifest Data:
Document ID: NYG0926829
Manifest Status: Not reported
Trans1 State ID: AM8365
Year: 1997
Trans2 State ID: Not reported
Generator Ship Date: 08/19/1997
Trans1 Recv Date: 08/19/1997
Trans2 Recv Date: Not reported
TSD Site Recv Date: 08/19/1997
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD987016136
Trans1 EPA ID: NYD013277454
Trans2 EPA ID: Not reported
TSDF ID 1: NYD013277454
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: CADMIUM
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00220
Units: Gallons (liquids only)
Number of Containers: 004
Container Type: Metal drums, barrels, kegs
Handling Method: Burn
Specific Gravity: 01.00

Document ID: NYG1656369
Manifest Status: Not reported

PROJECT ORANGE (Continued) **1000790137**

Trans1 State ID:	49187AK
Year:	1999
Trans2 State ID:	TLK5558OH
Generator Ship Date:	06/15/1999
Trans1 Recv Date:	06/15/1999
Trans2 Recv Date:	06/17/1999
TSD Site Recv Date:	06/18/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	OHD001926740
TSDF ID 1:	OHD001926740
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	MERCURY
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00075
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG1658025
Manifest Status:	Not reported
Trans1 State ID:	AM8365
Year:	1999
Trans2 State ID:	Not reported
Generator Ship Date:	08/05/1999
Trans1 Recv Date:	08/05/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/05/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported

PROJECT ORANGE (Continued) **1000790137**

Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	CADMIUM
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00110
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG0222624
Manifest Status:	Not reported
Trans1 State ID:	Not reported
Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	05/30/1997
Trans1 Recv Date:	05/30/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/30/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS, EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC, AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF

PROJECT ORANGE (Continued) **1000790137**

	ALUMINUM.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00165
Units:	Gallons (liquids only)
Number of Containers:	003
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYG0221526
Manifest Status:	Not reported
Trans1 State ID:	HU7905
Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	04/17/1997
Trans1 Recv Date:	04/17/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/17/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	CADMIUM
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00650
Units:	Pounds
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYG0222084
Manifest Status:	Not reported
Trans1 State ID:	AM8365

PROJECT ORANGE (Continued) **1000790137**

Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	04/24/1997
Trans1 Recv Date:	04/24/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/24/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	CADMIUM
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00110
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYG0222147
Manifest Status:	Not reported
Trans1 State ID:	HU7905
Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	04/25/1997
Trans1 Recv Date:	04/25/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/25/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported

PROJECT ORANGE (Continued) **1000790137**

Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00018
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	NJD071629976
Generator Ship Date:	12/17/2010
Trans1 Recv Date:	12/17/2010
Trans2 Recv Date:	12/21/2010
TSD Site Recv Date:	12/31/2010
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	KYD053348108
TSDF ID 2:	Not reported
Manifest Tracking Number:	003842193FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported

PROJECT ORANGE (Continued) **1000790137**

Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H061
Waste Code a:	TRICHLORETHYLENE
Waste Code b:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	7600
Units:	Pounds
Number of Containers:	4
Container Type:	Portable tanks
Handling Method:	Burn
Specific Gravity:	1

Document ID:	NYG0345717
Manifest Status:	Not reported
Trans1 State ID:	EZ1099
Year:	1998
Trans2 State ID:	Not reported
Generator Ship Date:	01/27/1998
Trans1 Recv Date:	01/27/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/27/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported

PROJECT ORANGE (Continued) **1000790137**

Waste Code 1:	CADMIUM
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00055
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYG0346968
Manifest Status:	Not reported
Trans1 State ID:	MX3142
Year:	1998
Trans2 State ID:	Not reported
Generator Ship Date:	03/06/1998
Trans1 Recv Date:	03/06/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	03/06/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	CADMIUM
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00110
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYG0347661
Manifest Status:	Not reported
Trans1 State ID:	EZ1099

PROJECT ORANGE (Continued) **1000790137**

Year:	1998
Trans2 State ID:	Not reported
Generator Ship Date:	04/10/1998
Trans1 Recv Date:	04/10/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/10/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	CADMIUM
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00110
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Click this hyperlink while viewing on your computer to access
64 additional NY MANIFEST: record(s) in the EDR Site Report.

S87 **SYRACUSE COMMUNITY HEALTH CENTER** **RCRA-SQG** **1016144340**
SW **930 S SALINA ST** **FINDS** **NYR000199190**
1/8-1/4 **SYRACUSE, NY 13202** **ECHO**
0.198 mi. **NY MANIFEST**
1043 ft. **Site 1 of 3 in cluster S**

Relative: **Lower**
Actual: **394 ft.**

RCRA Listings:

Date Form Received by Agency:	20130228
Handler Name:	Syracuse Community Health Center
Handler Address:	S Salina St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYR000199190
Contact Name:	HARVEY L BOX
Contact Address:	PO BOX 515
Contact City,State,Zip:	SYRACUSE, NY 13205
Contact Telephone:	315-476-7917 x345

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

Contact Fax:	315-476-7990
Contact Email:	LBOX@HUEBER-BREVER.COM
Contact Title:	PROJECT MANAGER HUEBER BREVER CONST
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	S SALINA ST
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Schc Companies Inc
Owner Type:	Private
Operator Name:	Dr Ruben Cowart
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150730
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

Sub-Part P Indicator: No

Handler - Owner Operator:
Owner/Operator Indicator: Owner
Owner/Operator Name: SCHC COMPANIES INC
Legal Status: Private
Date Became Current: 20050614
Date Ended Current: Not reported
Owner/Operator Address: 819 S SALINA ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-476-7921
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: DR RUBEN COWART
Legal Status: Private
Date Became Current: 20050614
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20130228
Handler Name: SYRACUSE COMMUNITY HEALTH CENTER
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 621111
NAICS Description: OFFICES OF PHYSICIANS (EXCEPT MENTAL HEALTH SPECIALISTS)

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

Registry ID: 110055471458

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1016144340
Registry ID:	110055471458
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110055471458
Name:	SYRACUSE COMMUNITY HEALTH CENTER
Address:	930 S SALINA ST
City,State,Zip:	SYRACUSE, NY 13202

NY MANIFEST:

EPA ID:	NYR000199190
Country:	USA
Name:	SYRACUSE COMMUNITY HEALTH CENTER
Address:	930 S SALINA ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	930 S SALINA ST
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	SYRACUSE COMMUNITY HEALTH CENTER
Mailing Contact:	SYRACUSE COMMUNITY HEALTH CENTER
Mailing Address 1:	930 S SALINA ST
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3153742549

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	03/29/2013
Trans1 Recv Date:	03/29/2013
Trans2 Recv Date:	Not reported

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

TSD Site Recv Date:	04/05/2013
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000199190
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	005727802FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	IGNITABLE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	20
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	03/29/2013
Trans1 Recv Date:	03/29/2013
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/05/2013
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000199190
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	005727802FLE
Import Indicator:	N

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	CORROSIVE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	03/29/2013
Trans1 Recv Date:	03/29/2013
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/05/2013
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000199190
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	005727802FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

Waste Code a:	CORROSIVE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	3
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	03/29/2013
Trans1 Recv Date:	03/29/2013
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/05/2013
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000199190
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	005727803FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	IGNITABLE WASTE
Waste Code b:	BENZENE, METHYL- (OR) TOLUENE
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	36
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	03/29/2013
Trans1 Recv Date:	03/29/2013
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/11/2013
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000199190
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	005727804FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H132
Waste Code a:	B007
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1030
Units:	Kilograms
Number of Containers:	3
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

S88 **SYRACUSE COMMUNITY HEALTH CENTER INC** **RCRA NonGen / NLR** **1010328399**
SW **819 S SALINA ST** **NY MANIFEST** **NYR000142984**
1/8-1/4 **SYRACUSE, NY 13702**
0.198 mi.
1046 ft. **Site 2 of 3 in cluster S**

Relative: **Lower**

Actual: **396 ft.**

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	Syracuse Community Health Center Inc
Handler Address:	S Salina St
Handler City,State,Zip:	SYRACUSE, NY 13702-3527
EPA ID:	NYR000142984
Contact Name:	LARRY WEBB
Contact Address:	S SALINA ST
Contact City,State,Zip:	SYRACUSE, NY 13702-3527
Contact Telephone:	315-476-7921
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	S SALINA ST
Mailing City,State,Zip:	SYRACUSE, NY 13702-3527
Owner Name:	No Name Found
Owner Type:	Private
Operator Name:	No Name Found
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No

SYRACUSE COMMUNITY HEALTH CENTER INC (Continued) **1010328399**

Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name: NO NAME FOUND	
Legal Status:	Private
Date Became Current:	19700101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: SYRACUSE COMMUNITY HEALTH CARE INC	
Legal Status:	Private
Date Became Current:	19700101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name: SYRACUSE COMMUNITY HEALTH CARE INC	
Legal Status:	Private
Date Became Current:	19700101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported

SYRACUSE COMMUNITY HEALTH CENTER INC (Continued) **1010328399**

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NO NAME FOUND
Legal Status: Private
Date Became Current: 19700101
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20061127
Handler Name: SYRACUSE COMMUNITY HEALTH CENTER INC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: SYRACUSE COMMUNITY HEALTH CENTER INC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20061128
Handler Name: SYRACUSE COMMUNITY HEALTH CENTER INC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 621399

SYRACUSE COMMUNITY HEALTH CENTER INC (Continued) **1010328399**

NAICS Description: OFFICES OF ALL OTHER MISCELLANEOUS HEALTH PRACTITIONERS

Has the Facility Received Notices of Violations:

Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Evaluation Action Summary:

Evaluation Date:	20081204
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier:	NYBRS
Evaluation Responsible Sub-Organization:	R7
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

SYRACUSE COMMUNITY HEALTH CENTER INC (Continued) **1010328399**

NY MANIFEST:

EPA ID:	NYR000142984
Country:	USA
Name:	SYRACUSE COMMUNITY HEALTH CENTER
Address:	819 S SALINA ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13702-3527
Zip 4:	Not reported
Location Address 1:	819 S SALINA ST
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	SYRACUSE COMMUNITY HEALTH CENTER
Mailing Contact:	JOHN W THOMAS
Mailing Address 1:	819 S SALINA ST
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3155756276

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	VTR000500090
Year:	2018
Trans2 State ID:	NYD980761191
Generator Ship Date:	07/12/2007
Trans1 Recv Date:	07/12/2007
Trans2 Recv Date:	07/23/2007
TSD Site Recv Date:	07/23/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000142984
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	000051496FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	IGNITABLE WASTE
Waste Code b:	Not reported

SYRACUSE COMMUNITY HEALTH CENTER INC (Continued) **1010328399**

Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	200
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	VTR000500090
Year:	2018
Trans2 State ID:	NYD980761191
Generator Ship Date:	06/08/2007
Trans1 Recv Date:	06/08/2007
Trans2 Recv Date:	06/18/2007
TSD Site Recv Date:	06/18/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000142984
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	000051379FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	IGNITABLE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported

SYRACUSE COMMUNITY HEALTH CENTER INC (Continued) **1010328399**

Quantity:	500
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

S89 **SYRACUSE COMMUNITY HEALTH CENTER INC** **PA MANIFEST** **S109247644**
SW **819 SOUTH SALINA STREET** **N/A**
1/8-1/4 **SYRACUSE, NY**
0.198 mi.
1046 ft. **Site 3 of 3 in cluster S**

Relative: PA MANIFEST:
Lower

Actual:
396 ft.

Name:	SYRACUSE COMMUNITY HEALTH CENTER INC
Address:	819 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY
Year:	2007
Manifest Number:	000051379FLE
Manifest Type:	Not reported
Generator EPA ID:	NYR000142984
Generator Date:	06/08/2007
Mailing Address:	Not reported
Contact Name:	LARRY WEBB
Contact Phone:	315-476-7921
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D001
Container Number:	1
Container Type:	CF
Waste Quantity:	500
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

Year:	2007
Manifest Number:	000051496FLE
Manifest Type:	Not reported
Generator EPA ID:	NYR000142984
Generator Date:	07/12/2007
Mailing Address:	Not reported
Contact Name:	LARRY WEBB
Contact Phone:	315-476-7921
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA

SYRACUSE COMMUNITY HEALTH CENTER INC (Continued) **S109247644**

Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D001
Container Number:	1
Container Type:	DM
Waste Quantity:	200
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

T90 **HARRISON CONVENTION CTR** **UST FINDER RELEASE** **1029058859**
NNW **HARRISON & MONTGOMERY** **N/A**
1/8-1/4 **SYRACUSE, NY 0**
0.200 mi.
1054 ft. **Site 1 of 4 in cluster T**

Relative: **Lower**

Actual: **394 ft.**

UST FINDER RELEASE:

Object ID:	249469
Facility ID:	NY129785
Lust ID:	NY9010462
Name:	HARRISON CONVENTION CTR
Address:	HARRISON & MONTGOMERY
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1990/12/28 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1746
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.14884
Y Coord:	43.04427
Latitude:	43.0442699999999
Longitude:	-76.14884

P91 **NYSDOT BIN 1031569** **RCRA NonGen / NLR** **1000889982**
ESE **I-81/EAST ADAMS STREET** **NY MANIFEST** **NY0000202481**
1/8-1/4 **SYRACUSE, NY 13202**
0.201 mi.
1063 ft. **Site 2 of 2 in cluster P**

Relative:
Higher

Actual:
409 ft.

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	Nysdot Bin 1031569
Handler Address:	I-81/East Adams Street
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NY0000202481
Contact Name:	RICHARD S STEELE
Contact Address:	SOUTH WARREN STREET
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-448-7363
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	SOUTH WARREN STREET
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Nysdot
Owner Type:	State
Operator Name:	Nysdot
Operator Type:	State
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No

NYSDOT BIN 1031569 (Continued) **1000889982**

Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Biennial: List of Years
Year: 2001

Click Here for Biennial Reporting System Data:

Hazardous Waste Summary:
Waste Code: D000
Waste Description: Not Defined

Waste Code: D008
Waste Description: Lead

Waste Code: NONE
Waste Description: Not Defined

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: NYSDOT	
Legal Status:	State
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	109 S WARREN ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-448-7342
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: NYSDOT	
Legal Status:	State
Date Became Current:	20010101
Date Ended Current:	Not reported
Owner/Operator Address:	109 S WARREN ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-448-7342
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

NYSDOT BIN 1031569 (Continued) **1000889982**

Owner/Operator Indicator:	Operator
Owner/Operator Name: NYSDOT	
Legal Status:	State
Date Became Current:	20010101
Date Ended Current:	Not reported
Owner/Operator Address:	109 S WARREN ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-448-7342
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	19950227
Handler Name: NYSDOT BIN 1031569	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20060101
Handler Name: NYSDOT BIN 1031569	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20070101
Handler Name: NYSDOT BIN 1031569	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	19940411
Handler Name: NYSDOT BIN 1031569	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No

NYSDOT BIN 1031569 (Continued) **1000889982**

Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20010521
Handler Name: NYSDOT BIN 1031569	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20020227
Handler Name: NYSDOT BIN 1031569	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Code:	23412
NAICS Description:	BRIDGE AND TUNNEL CONSTRUCTION

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

NY MANIFEST:

EPA ID:	NY0000202481
Country:	USA
Name:	NEW YORK STATE DEPT OF TRANSPORTATION
Address:	RTE I-81 OVER E ADAMS ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	UNDER I-81 ADAM ST
Location Address 2:	Not reported

NYSDOT BIN 1031569 (Continued) **1000889982**

Location City,State,Zip: SYRACUSE, NY
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: NEW YORK STATE DEPT OF TRANSPORTATION
Mailing Contact: DANIEL F WEAVER
Mailing Address 1: 3522 JAMES ST SUITE 206
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13206
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154379886

Manifest Data:
Document ID: NYG1987011
Manifest Status: Not reported
Trans1 State ID: AB32265
Year: 2001
Trans2 State ID: Not reported
Generator Ship Date: 07/19/2001
Trans1 Recv Date: 07/19/2001
Trans2 Recv Date: Not reported
TSD Site Recv Date: 07/20/2001
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NY0000202481
Trans1 EPA ID: NYD986903904
Trans2 EPA ID: Not reported
TSDF ID 1: NYD049836679
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: LEAD
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 12500
Units: Pounds
Number of Containers: 025
Container Type: Metal drums, barrels, kegs
Handling Method: Treat
Specific Gravity: 01.00

NYSDOT BIN 1031569 (Continued) **1000889982**

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJR986628162
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	11/05/2015
Trans1 Recv Date:	11/05/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/05/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000202481
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD991291105
TSDF ID 2:	Not reported
Manifest Tracking Number:	008273657FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code a:	LEAD
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	500
Units:	Pounds
Number of Containers:	2
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	1

Document ID:	NYG3113442
Manifest Status:	Not reported
Trans1 State ID:	AB32265NY
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	10/03/2001
Trans1 Recv Date:	10/03/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/08/2001
Part A Recv Date:	Not reported

NYSDOT BIN 1031569 (Continued) **1000889982**

Part B Recv Date:	Not reported
Generator EPA ID:	NY0000202481
Trans1 EPA ID:	NYD986903904
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	LEAD
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	32000
Units:	Pounds
Number of Containers:	040
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00

Document ID:	NYB6578505
Manifest Status:	Not reported
Trans1 State ID:	Not reported
Year:	1994
Trans2 State ID:	Not reported
Generator Ship Date:	11/01/1994
Trans1 Recv Date:	11/01/1994
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/04/1994
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000202481
Trans1 EPA ID:	NYD980769947
Trans2 EPA ID:	Not reported
TSDF ID 1:	OHD066060609
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported

NYSDOT BIN 1031569 (Continued) **1000889982**

Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	LEAD
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	02500
Units:	Pounds
Number of Containers:	005
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00

---

92 **SYRACUSE HOUSING AUTHORITY** **RCRA NonGen / NLR** **1004570531**
SE **516 BURT ST** **FINDS** **NYD981873599**
1/8-1/4 **SYRACUSE, NY 13202** **ECHO**
0.213 mi. **NY MANIFEST**
1125 ft.

Relative: **Higher**

Actual: **410 ft.**

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	Syracuse Housing Authority
Handler Address:	Burt St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYD981873599
Contact Name:	EILEEN D GILLIGAN
Contact Address:	BURT ST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-475-6181
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	BURT ST
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Syracuse Housing Authority
Owner Type:	Municipal
Operator Name:	Syracuse Housing Authority
Operator Type:	Municipal
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Biennial: List of Years
Year: 2001

Click Here for Biennial Reporting System Data:

Hazardous Waste Summary:
Waste Code: D000
Waste Description: Not Defined

Waste Code: D008
Waste Description: Lead

Waste Code: NONE
Waste Description: Not Defined

Waste Code: X002
Waste Description: Not Defined

Handler - Owner Operator:
Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY
Legal Status: Municipal
Date Became Current: Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Date Ended Current: Not reported
Owner/Operator Address: 516 BURT ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-475-6181
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 516 BURT ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-475-6181
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 516 BURT ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-475-6181
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 19950519
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Not reported
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19961125
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19980227
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20020618
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 53111
NAICS Description: LESSORS OF RESIDENTIAL BUILDINGS AND DWELLINGS

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

NAICS Code: 92511
NAICS Description: ADMINISTRATION OF HOUSING PROGRAMS

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110000809457

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
All generators and treatment, storage, and disposal (TSD) facilities who handle hazardous waste are required to report to the EPA Administrator at least once every two years. The data collected is used to create the National Biennial Resource Conservation and Recovery Act (RCRA) Hazardous Waste Report. This data is processed within the RCRA Information (RCRAInfo) database
The Integrated Compliance Information System (ICIS) provides a database that, when complete, will contain integrated enforcement and compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions and a subset of the Permit Compliance System (PCS), which supports the National Pollutant Discharge Elimination System (NPDES). This information is maintained in ICIS by EPA in the Regional offices and it at Headquarters. A future release of ICIS will completely replace PCS and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities that support compliance and enforcement programs, including incident tracking, compliance assistance, and compliance monitoring.
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1004570531
Registry ID: 110000809457
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110000809457
Name: SYRACUSE HOUSING AUTHORITY
Address: 516 BURT ST
City,State,Zip: SYRACUSE, NY 13202

NY MANIFEST:

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

EPA ID: NYD981873599
Country: USA
Name: SYRACUSE HOUSING AUTHORITY
Address: 516 BURT ST
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported
Location Address 1: 300 BURT STREET
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: SYRACUSE HOUSING AUTHORITY
Mailing Contact: CARY BARBER
Mailing Address 1: 516 BURT STREET
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3156474221

Manifest Data:
Document ID: NHG0004600
Manifest Status: Not reported
Trans1 State ID: PR5398NY
Year: 2002
Trans2 State ID: Not reported
Generator Ship Date: 01/10/2002
Trans1 Recv Date: 01/10/2002
Trans2 Recv Date: Not reported
TSD Site Recv Date: 01/14/2002
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981873599
Trans1 EPA ID: NYD980761191
Trans2 EPA ID: Not reported
TSDF ID 1: NHD018902874
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: B001
Waste Code 2: Not reported
Waste Code 3: Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00003
Units:	Kilograms
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Document ID:	NYB7405668
Manifest Status:	Not reported
Trans1 State ID:	NY2281OH
Year:	1995
Trans2 State ID:	Not reported
Generator Ship Date:	12/05/1995
Trans1 Recv Date:	12/05/1995
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/06/1995
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981873599
Trans1 EPA ID:	NYD982792814
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	LEAD
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00150
Units:	Pounds
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Waste Code 7:	LEAD
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00375
Units:	Pounds

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Number of Containers: 005
Container Type: Metal drums, barrels, kegs
Handling Method: Landfill
Specific Gravity: 01.00

Document ID: MAG0910650
Manifest Status: Not reported
Trans1 State ID: TNY34284
Year: 1996
Trans2 State ID: Not reported
Generator Ship Date: 12/20/1996
Trans1 Recv Date: 12/20/1996
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/30/1996
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981873599
Trans1 EPA ID: MAD019371079
Trans2 EPA ID: Not reported
TSDF ID 1: MAD019371079
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: CADMIUM
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00055
Units: Gallons (liquids only)
Number of Containers: 001
Container Type: Metal drums, barrels, kegs
Handling Method: Landfill
Specific Gravity: 01.00

Document ID: NYB8711514
Manifest Status: Not reported
Trans1 State ID: 67285KNY
Year: 1997
Trans2 State ID: Not reported
Generator Ship Date: 01/23/1997
Trans1 Recv Date: 01/23/1997
Trans2 Recv Date: Not reported
TSD Site Recv Date: 01/24/1997
Part A Recv Date: Not reported
Part B Recv Date: Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Generator EPA ID:	NYD981873599
Trans1 EPA ID:	NYD000688671
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B007
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	14941
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYB8711523
Manifest Status:	Not reported
Trans1 State ID:	8375577NY
Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	01/24/1997
Trans1 Recv Date:	01/24/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/28/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981873599
Trans1 EPA ID:	NYD046765574
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

MGMT Method Type Code:	Not reported
Waste Code 1:	B001
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	04800
Units:	Kilograms
Number of Containers:	004
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	B006
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00800
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG1960578
Manifest Status:	Not reported
Trans1 State ID:	NPF236KS
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	07/09/2001
Trans1 Recv Date:	07/09/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/09/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981873599
Trans1 EPA ID:	SCR000074591
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD981113749
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B002
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	02455
Units:	Kilograms
Number of Containers:	002
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	B003
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	01245
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Recycle
Specific Gravity:	01.00

R93 **SYRACUSE HOUSING AUTHORITY TOOMEY AGGO TOWER** **PA MANIFEST** **S110049554**
ESE **1207 ALMOND STREET** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.220 mi.
1159 ft. **Site 2 of 3 in cluster R**

Relative: **Higher**

Actual: **410 ft.**

PA MANIFEST:

Name:	SYRACUSE HOUSING AUTHORITY TOOMEY AGGO TOWER
Address:	1207 ALMOND STREET
City,State,Zip:	SYRACUSE, NY 13202
Year:	2008
Manifest Number:	000885781FLE
Manifest Type:	T
Generator EPA ID:	NYR000154468
Generator Date:	03/12/2008
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-470-4315
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D002
Container Number:	1
Container Type:	DF
Waste Quantity:	55
Unit:	G
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

R94 **SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE** **RCRA-SQG** **1010566799**
ESE **1207 ALMOND ST** **E MANIFEST** **NYR000154468**
1/8-1/4 **SYRACUSE, NY 13202** **NY MANIFEST**
0.220 mi.
1159 ft. **Site 3 of 3 in cluster R**

Relative: **Higher**

Actual: **410 ft.**

RCRA Listings:

Date Form Received by Agency:	20080205
Handler Name:	Syracuse Housing Auth - Toomey Aggo Towe
Handler Address:	Almond St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYR000154468
Contact Name:	WILLIAM W GEHRKE
Contact Address:	BURT ST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-470-4315
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Other
Federal Waste Generator Description:	Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	ALMOND ST
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No

SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE (Continued) **1010566799**

Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D002
Waste Description:	Corrosive Waste

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name:	SYRACUSE HOUSING AUTH
Legal Status:	Other
Date Became Current:	19690101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name:	SYRACUSE HOUSING AUTH
Legal Status:	Other
Date Became Current:	19690101
Date Ended Current:	Not reported
Owner/Operator Address:	516 BURT ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20080205
Handler Name:	SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE
Federal Waste Generator Description:	Small Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No

SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE (Continued) **1010566799**

Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080206
Handler Name: SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWER
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 92511
NAICS Description: ADMINISTRATION OF HOUSING PROGRAMS

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

E MANIFEST:
Manifest Tracking Number: 006546910GBF
Last Updated Date: 20210920
Shipped Date: 20210813
Received Date: 20210910
Manifest Status: Signed
Submission Type: DataImage5Copy
Origin Type: Service
Generator EPA ID: NYR000154468
Generator Name: Syracuse Housing Authority
Generator Mail Street Number: Not reported
Generator Mail Street 1: 1207 ALMOND ST
Generator Mail Street 2: Not reported
Generator Mail City: SYACUSE
Generator Mail State: NY
Generator Mail Zip: 13210
Generator Location Street Number: Not reported
Generator Location Street 1: 516 BURT ST
Generator Location Street 2: Not reported
Generator Location City: SYACUSE
Generator Location Zip: 13202
Generator Location State: NY
Generator Contact Company Name: Not reported
Designated Facility EPA ID: MID048090633
Designated Facility Name: Not reported
Designated Facility Mail Street Number: Not reported
Designated Facility Mail Street 1: Not reported

SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE (Continued) **1010566799**

Designated Facility Mail Street 2:	49350 N I-94 SERVICE DRIVE
Designated Facility Mail City:	BELLEVILLE
Designated Facility Mail Zip:	48111
Designated Facility Mail State:	MI
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	49350 N I-94 SERVICE DRIVE
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	BELLEVILLE
Designated Facility Location Zip:	48111
Designated Facility Location State:	MI
Designated Facility Contact Company Name:	WAYNE DISPOSAL, INC. SITE #2 LANDFILL
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	011099030FLE
Last Updated Date:	20190225
Shipped Date:	20181128
Received Date:	20181206
Manifest Status:	Corrected
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYR000154468
Generator Name:	Syracuse Housing Auth - Toomey Aggo Towe
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	1207 ALMOND ST
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13202
Generator Location Street Number:	Not reported
Generator Location Street 1:	1207 ALMOND ST
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location Zip:	13202
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	VTR000517052
Designated Facility Name:	Enpro Services Of Vermont, Inc.
Designated Facility Mail Street Number:	54
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	54 AVENUE D
Designated Facility Mail City:	WILLISTON
Designated Facility Mail Zip:	05495
Designated Facility Mail State:	VT
Designated Facility Location Street Number:	54
Designated Facility Location Street 1:	54 AVENUE D
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	WILLISTON
Designated Facility Location Zip:	05495
Designated Facility Location State:	VT
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

State Waste:

Manifest Tracking Number:	011099030FLE
Waste Line Number:	1

SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE (Continued) **1010566799**

State Waste Code Owner: NY
State Waste Code: B007
State Waste: Other PCB wastes, including contaminated soil, solids, sludges, clothing, rags and dredge material.

Manifest Tracking Number: 011099030FLE
Waste Line Number: 1
State Waste Code Owner: VT
State Waste Code: VT01
State Waste: Vt01

Transporter:
Manifest Tracking Number: 011099030FLE
Transporter Line Number: 1
Transporter EPA ID: NYR000115733
Transporter Name: Environmental Prod & Svcs Of Vermont Inc

Waste Line:
Manifest Tracking Number: 011099030FLE
Waste Line Number: 1
U.S. DOT Hazardous Indicator: Y
U.S. DOT ID Number: UN3432
U.S. DOT Description: Un3432, Polychlorinated Biphenyls, Solid 9, Pgiii
Non-Hazardous Waste Description: Not reported
Number of Containers: 7
Container Type Code: DM
Container Type Description: Metal drums, barrels, kegs
Waste Quantity: 1800
Quantity Unit of Measure Code: K
Quantity Unit of Measure Description: Kilograms
Waste Quantity, in Tons: 1.9844987
Acute Waste Quantity, in Tons: 0
Non-Acute Waste Quantity, in Tons: 1.9844987
Waste Quantity, in Kilograms: 1800
Acute Waste Quantity, in Kilograms: 0
Non-Acute Waste Quantity, in Kilorgrams: 1800
Management Method Code: H141
Management Method Description: STORAGE, BULKING AND/OR TRANSFER OFF SITE
Waste Residue Indicator: N
Quantity Discrepancy Indicator: N
Waste Type Discrepancy Indicator: N
Waste Density: Not reported
Waste Density Unit of Measure Code: Not reported
Waste Density Unit of Measure Description: Not reported
Form Code: Not reported
Form Code Description: Not reported
Source Code: Not reported
Source Code Description: Not reported
Waste Minimization Code: Not reported
Waste Minimization Code Description: Not reported
Consent Number: Not reported
EPA Waste Indicator: N

NY MANIFEST:
EPA ID: NYR000154468
Country: USA

SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE (Continued) **1010566799**

Name: SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWER
Address: 1207 ALMOND ST
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported
Location Address 1: 1207 ALMOND ST
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWER
Mailing Contact: WILLIAM GEHRKE
Mailing Address 1: 516 BURT ST
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154704315

Manifest Data:
Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NYR000115733
Year: 2018
Trans2 State ID: NYD980761191
Generator Ship Date: 03/12/2008
Trans1 Recv Date: 03/12/2008
Trans2 Recv Date: 03/21/2008
TSD Site Recv Date: 03/25/2008
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000154468
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: PAD067098822
TSDF ID 2: Not reported
Manifest Tracking Number: 000885781FLE
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H141
Waste Code a: CORROSIVE WASTE
Waste Code b: Not reported
Waste Code c: Not reported
Waste Code e: Not reported
Waste Code f: Not reported

SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE (Continued) **1010566799**

Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	55
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

95
WNW
1/8-1/4
0.222 mi.
1172 ft.

NIAGARA MOHAWK POWER CORP MH8-4 **RCRA-SQG** **1031075964**
599 S SALINA MH8-4 **NYP000263509**
SYRACUSE, NY 13202

Relative:
Lower

Actual:
392 ft.

RCRA Listings:

Date Form Received by Agency:	20231227
Handler Name:	Niagara Mohawk Power Corp Mh8-4
Handler Address:	S Salina Mh8-4
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYP000263509
Contact Name:	ERIN URBANSKI
Contact Address:	ERIE BLVD WEST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	716-329-2302
Contact Fax:	Not reported
Contact Email:	ERIN.URBANSKI@NATIONALGRID.COM
Contact Title:	DIVISIONAL ENGINEER
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	ERIE BLVD WEST
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Niagara Mohawk Power Corp A National Grid Co
Owner Type:	Private
Operator Name:	Niagara Mohawk Power Corp A National Grid Co
Operator Type:	Private
Short-Term Generator Activity:	Yes
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No

NIAGARA MOHAWK POWER CORP MH8-4 (Continued) **1031075964**

Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20240103
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	NIAGARA MOHAWK POWER CORP A NATIONAL GRID CO
Legal Status:	Private
Date Became Current:	20000905
Date Ended Current:	Not reported
Owner/Operator Address:	300 ERIE BLVD WEST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-474-1511
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	NATHAN.BUTERA@NATIONALGRID.COM

Owner/Operator Indicator:	Operator
Owner/Operator Name:	NIAGARA MOHAWK POWER CORP A NATIONAL GRID CO
Legal Status:	Private
Date Became Current:	20000905
Date Ended Current:	Not reported
Owner/Operator Address:	300 ERIE BLVD WEST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-474-1511
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	NATHAN.BUTERA@NATIONALGRID.COM

NIAGARA MOHAWK POWER CORP MH8-4 (Continued) **1031075964**

Historic Generators:
Receive Date: 20231227
Handler Name: NIAGARA MOHAWK POWER CORP MH8-4
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

List of NAICS Codes and Descriptions:
NAICS Code: 221122
NAICS Description: ELECTRIC POWER DISTRIBUTION

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

U96 **AMERICAN RED CROSS** **NY Spills** **1009226448**
NW **636 SOUTH WARREN ST** **NY MANIFEST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.223 mi.
1176 ft. **Site 1 of 2 in cluster U**

Relative: **Lower**

Actual: **392 ft.**

SPILLS:
Name: CONSTRUCTION SITE-CENTRO BUS
Address: 636 SOUTH WARREN ST
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 1012524 / 2011-10-17
Facility ID: 1012524
Facility Type: ER
DER Facility ID: 401328
Site ID: 446700
DEC Region: 7
Spill Cause: Other
Spill Class: C4
SWIS: 3415
Spill Date: 2011-03-16
Investigator: KACAHILL
Referred To: Not reported
Reported to Dept: 2011-03-16
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False

AMERICAN RED CROSS (Continued) **1009226448**

UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2011-03-16
Spill Record Last Update:	2012-09-10
Spiller Name:	PAUL ZEMOTEL
Spiller Company:	CENTRO BUS
Spiller Address:	636 SOUTH WARREN ST
Spiller Company:	999
Contact Name:	PAUL ZEMOTEL-HUBERT BREWER CO
Latitude:	43.0437281
Longitude:	-76.1509304
DEC Memo:	03/17/11 Spoke to Paul and he indicated that they had stopped digging when contamination was discovered on 3/16 and were waiting for waste characterization sample results to come back. CES collected sample from bottom of excavation on 3/16/11. He indicated that excavation had been backfilled and that they planned to dig and load directly into trucks once they got landfill approval. Spoke to Nicki and she confirmed this and indicated that the results would not be back until Monday. She told me she would call me on Monday once she had results. 03/18/11 Received call from Paul indicating that they had resumed excavation in an area they thought was not contaminated and encountered petrolem impacted soil. He indicated that CES was onsite and contaminated soil was removed from excavation and stockpiled. I called Nicki and asked her why I was not contacted and she said it was a last minute thing . We made arrangements to meet at site first thing Monday morning. 03/21/10 Received a call from Paul at approx 0830 to inform me that they were not digging due to heavy rain, however, he wanted to meet with me and Nicki to make sure we were all on the same page . Arrived at site at 1330 and observed two large piles of covered soil. Half the footprint of bldg had been backfilled and leveled. Nicki indicated that they had excavated soil on 3/18 down to a native clay layer until PID readings were below 5 ppm and that she had collected 4 bottom samples. Paul indicated that they had encountered two round brick tanks in excavation approx 5 feet in diameter. I asked them if they could excavate a bucket or two just beyond backfilled area so I could observe contaminated soil. Odor was apparent along with black staining in soil. I indicated that based on what I was observing, it was not necessary to dig more then they had to for the footprint of building. Instructed them to contact me if they encountered free product or heavily contaminated soil and I would come to site. I instructed Nicki to follow DER-10 for confirmation sampling requirements. 10/17/11 Closed spill. Didn’t receive final revised report.
Remarks:	Contaminated soil on site. Cleanup pending upon assessment.

AMERICAN RED CROSS (Continued) **1009226448**

All Materials:

Site ID:	446700
Operable Unit ID:	1196838
Operable Unit:	01
Material ID:	2193147
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

NY MANIFEST:

EPA ID:	NYD986901312
Country:	USA
Name:	AMERICAN RED CROSS
Address:	636 SOUTH WARREN ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	636 SOUTH WARREN ST
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	AMERICAN RED CROSS
Mailing Contact:	AMERICAN RED CROSS
Mailing Address 1:	636 SOUTH WARREN ST
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154251666

Manifest Data:

Document ID:	MAH2626300
Manifest Status:	Not reported
Trans1 State ID:	MAB77684
Year:	1993
Trans2 State ID:	ME619010
Generator Ship Date:	07/28/1993
Trans1 Recv Date:	07/28/1993
Trans2 Recv Date:	07/28/1993
TSD Site Recv Date:	07/29/1993
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986901312
Trans1 EPA ID:	MAD039322250

AMERICAN RED CROSS (Continued) **1009226448**

Trans2 EPA ID:	MAD039322250
TSDF ID 1:	MAD980523203
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Waste Code 7:	SODIUM AZIDE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00001
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Waste Code 12:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code 13:	Not reported

AMERICAN RED CROSS (Continued) **1009226448**

Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00003
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Waste Code 17:	MERCURY
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00040
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00

Document ID:	MAH2626310
Manifest Status:	Not reported
Trans1 State ID:	MAB77684
Year:	1993
Trans2 State ID:	ME619010
Generator Ship Date:	07/28/1993
Trans1 Recv Date:	07/28/1993
Trans2 Recv Date:	07/28/1993
TSD Site Recv Date:	07/29/1993
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986901312
Trans1 EPA ID:	MAD039322250
Trans2 EPA ID:	MAD039322250
TSDF ID 1:	MAD980523203
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00001
Units:	Pounds

AMERICAN RED CROSS (Continued) **1009226448**

Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Waste Code 7:	IGNITABLE WASTE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00001
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Waste Code 12:	CORROSIVE WASTE
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00003
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Waste Code 17:	PHENOL
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

U97 **AMERICAN RED CROSS** **RCRA NonGen / NLR** **1004759770**
NW **636 S WARREN ST** **FINDS** **NYR000020446**
1/8-1/4 **SYRACUSE, NY 13202** **ECHO**
0.223 mi. **NY MANIFEST**
1176 ft. **Site 2 of 2 in cluster U**

Relative: **Lower**
Actual: **392 ft.**

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	American Red Cross
Handler Address:	S Warren St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYR000020446
Contact Name:	DAVID HARROUN
Contact Address:	S WARREN ST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-425-1666
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported

AMERICAN RED CROSS (Continued) **1004759770**

EPA Region:	02
Land Type:	Federal
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	S WARREN ST
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	The American National Red Cross
Owner Type:	Private
Operator Name:	The American National Red Cross
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	The land is federally-owned
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

AMERICAN RED CROSS (Continued) **1004759770**

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	D002
Waste Description:	Corrosive Waste
Waste Code:	U002
Waste Description:	2-Propanone (I) (Or) Acetone (I)
Waste Code:	U134
Waste Description:	Hydrofluoric Acid (C,T) (Or) Hydrogen Fluoride (C,T)
Waste Code:	U159
Waste Description:	2-Butanone (I,T) (Or) Methyl Ethyl Ketone (Mek) (I,T)
Waste Code:	U220
Waste Description:	Benzene, Methyl- (Or) Toluene
Waste Code:	U226
Waste Description:	Ethane, 1,1,1-Trichloro- (Or) Methyl Chloroform
Waste Code:	U239
Waste Description:	Benzene, Dimethyl- (I,T) (Or) Xylene (I)
Waste Code:	U240
Waste Description:	2,4-D, Salts & Esters (Or) Acetic Acid, (2,4-Dichlorophenoxy)-, Salts & Esters (Or) Dichlorophenoxyacetic Acid 2,4-D
Waste Code:	X003
Waste Description:	Not Defined

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name:	THE AMERICAN NATIONAL RED CROSS
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	636 S WARREN ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-425-1666
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name:	THE AMERICAN NATIONAL RED CROSS
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	636 S WARREN ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-425-1666
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

AMERICAN RED CROSS (Continued) **1004759770**

Owner/Operator Indicator: Owner
Owner/Operator Name: THE AMERICAN NATIONAL RED CROSS
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 636 S WARREN ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-425-1666
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20060101
Handler Name: AMERICAN RED CROSS
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: AMERICAN RED CROSS
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19960304
Handler Name: AMERICAN RED CROSS
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

AMERICAN RED CROSS (Continued) **1004759770**

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110004522810

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1004759770
Registry ID:	110004522810
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110004522810
Name:	AMERICAN RED CROSS
Address:	636 S WARREN ST
City,State,Zip:	SYRACUSE, NY 13202

NY MANIFEST:

EPA ID:	NYR000020446
Country:	USA
Name:	AMERICAN RED CROSS
Address:	636 S WARREN ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	636 SOUTH WARREN STREET
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	AMERICAN RED CROSS
Mailing Contact:	AMERICAN RED CROSS
Mailing Address 1:	636 SOUTH WARREN STREET
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154251666

AMERICAN RED CROSS (Continued) **1004759770**

Manifest Data:

Document ID:	MIA2825093
Manifest Status:	Not reported
Trans1 State ID:	48472VNY
Year:	1996
Trans2 State ID:	Not reported
Generator Ship Date:	03/29/1996
Trans1 Recv Date:	03/29/1996
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/02/1996
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000020446
Trans1 EPA ID:	NYD000708271
Trans2 EPA ID:	Not reported
TSDF ID 1:	MID096963194
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	CORROSIVE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00001
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00

Document ID:	NYB6662871
Manifest Status:	Not reported
Trans1 State ID:	48472VNY
Year:	1996
Trans2 State ID:	Not reported
Generator Ship Date:	03/29/1996
Trans1 Recv Date:	03/29/1996
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/08/1996
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000020446
Trans1 EPA ID:	NYD000708271
Trans2 EPA ID:	Not reported
TSDF ID 1:	FLD980559728

AMERICAN RED CROSS (Continued) **1004759770**

TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	HYDROFLUORIC ACID (C,T) (OR) HYDROGEN FLUORIDE (C,T)
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Waste Code 7:	CORROSIVE WASTE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00001
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Waste Code 12:	ETHANE, 1,1,1-TRICHLORO- (OR) METHYL CHLOROFORM
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00200
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	2-PROPANONE (I) (OR) ACETONE (I)
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00400
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn

AMERICAN RED CROSS (Continued) **1004759770**

Specific Gravity:	01.00
Document ID:	NYB6662889
Manifest Status:	Not reported
Trans1 State ID:	48472VNY
Year:	1996
Trans2 State ID:	Not reported
Generator Ship Date:	03/29/1996
Trans1 Recv Date:	03/29/1996
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/08/1996
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000020446
Trans1 EPA ID:	NYD000708271
Trans2 EPA ID:	Not reported
TSDF ID 1:	FLD980559728
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	2,4-D, SALTS & ESTERS (OR) ACETIC ACID, (2,4-DICHLOROPHENOXY)-, SALTS & ESTERS (OR) DICHLOROPHENOXYACETIC ACID 2,4-D
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	CORROSIVE WASTE
Waste Code 13:	Not reported
Waste Code 14:	Not reported

AMERICAN RED CROSS (Continued) **1004759770**

Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00010
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00

V98 **SOUTH SALINA SIDA** **NY SHWS** **S113916746**
SSW **1016-1018 MONTGOMERY ST.** **N/A**
1/8-1/4 **SYRACUSE, NY 13204**
0.224 mi.
1181 ft. **Site 1 of 3 in cluster V**

Relative: **Lower**

Actual: **392 ft.**

SHWS:

Name:	SOUTH SALINA SIDA
Address:	1016-1018 MONTGOMERY ST.
City,State,Zip:	SYRACUSE, NY 13204
Program:	HW
Site Code:	422215
Classification:	N
Region:	7
Acres:	Not reported
HW Code:	734120
Record Add:	11/25/2009
Record Upd:	02/19/2010
Updated By:	BRWOLOSE
Site Description:	"Description Not Available"
Env Problem:	""
Health Problem:	""
Dump:	Not reported
Structure:	Not reported
Lagoon:	Not reported
Landfill:	Not reported
Pond:	Not reported
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	Not reported
Record Upd:	Not reported
Updated By:	Not reported
Own Op:	1
Sub Type:	C01
Owner Name:	Not reported
Owner Company:	Syracuse Industrial Development Agency
Owner Address:	201 E. Washington Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	Not reported
Cross Ref Type Code:	Not reported

SOUTH SALINA SIDA (Continued) **S113916746**

Cross Ref Type: Not reported
Record Added Date: Not reported
Record Updated: Not reported
Updated By: Not reported

W99 **224 HARRISON ST ASSOC, LLC** **E MANIFEST** **1027788321**
NW **224 HARRISON ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.225 mi.
1187 ft. **Site 1 of 3 in cluster W**

Relative:
Lower

Actual:
393 ft.

E MANIFEST:

Manifest Tracking Number:	015217860FLE
Last Updated Date:	20201216
Shipped Date:	20201012
Received Date:	20201024
Manifest Status:	Corrected
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	CESQG
Generator Name:	224 Harrison St Assoc, Llc
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	224 HARRISON ST
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13202
Generator Location Street Number:	Not reported
Generator Location Street 1:	224 Harrison St
Generator Location Street 2:	Not reported
Generator Location City:	Syracuse
Generator Location Zip:	13202
Generator Location State:	NY
Generator Contact Company Name:	224 Harrison St Assoc, LLC
Designated Facility EPA ID:	ARD069748192
Designated Facility Name:	Clean Harbors El Dorado Llc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	309 American Circle
Designated Facility Mail City:	El Dorado
Designated Facility Mail Zip:	71730
Designated Facility Mail State:	AR
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	309 American Circle
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	El Dorado
Designated Facility Location Zip:	71730
Designated Facility Location State:	AR
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Federal Waste:

Manifest Tracking Number:	015217860FLE
Waste Line Number:	1
Federal Waste Code:	D001
Federal Waste:	IGNITABLE WASTE

224 HARRISON ST ASSOC, LLC (Continued) **1027788321**

Manifest Tracking Number: 015217860FLE
Waste Line Number: 2
Federal Waste Code: D002
Federal Waste: CORROSIVE WASTE

Transporter:
Manifest Tracking Number: 015217860FLE
Transporter Line Number: 1
Transporter EPA ID: MAD039322250
Transporter Name: Clean Harbors Environmental Services, Inc.

Manifest Tracking Number: 015217860FLE
Transporter Line Number: 2
Transporter EPA ID: NYD982792814
Transporter Name: Franks Vacuum Truck Service Inc

Manifest Tracking Number: 015217860FLE
Transporter Line Number: 3
Transporter EPA ID: MAD039322250
Transporter Name: Clean Harbors Environmental Services, Inc.

Manifest Tracking Number: 015217860FLE
Transporter Line Number: 4
Transporter EPA ID: MAD039322250
Transporter Name: Clean Harbors Environmental Services, Inc.

Waste Line:
Manifest Tracking Number: 015217860FLE
Waste Line Number: 1
U.S. DOT Hazardous Indicator: Y
U.S. DOT ID Number: UN1993
U.S. DOT Description: Un1993, Waste Flammable Liquids, N.O.S. (Non Haz Constituents Inclwater, Toluene), 3, Pg Ii
Non-Hazardous Waste Description: Not reported
Number of Containers: 1
Container Type Code: CF
Container Type Description: Fiber or plastic boxes, cartons, cases
Waste Quantity: 125
Quantity Unit of Measure Code: P
Quantity Unit of Measure Description: Pounds
Waste Quantity, in Tons: 0.0625
Acute Waste Quantity, in Tons: 0
Non-Acute Waste Quantity, in Tons: 0.0625
Waste Quantity, in Kilograms: 56.689377
Acute Waste Quantity, in Kilograms: 0
Non-Acute Waste Quantity, in Kilorgrams: 56.689377
Management Method Code: H040
Management Method Description: INCINERATION
Waste Residue Indicator: N
Quantity Discrepancy Indicator: N
Waste Type Discrepancy Indicator: N
Waste Density: Not reported
Waste Density Unit of Measure Code: Not reported
Waste Density Unit of Measure Description: Not reported
Form Code: Not reported
Form Code Description: Not reported

224 HARRISON ST ASSOC, LLC (Continued) **1027788321**

Source Code:	Not reported
Source Code Description:	Not reported
Waste Minimization Code:	Not reported
Waste Minimization Code Description:	Not reported
Consent Number:	Not reported
EPA Waste Indicator:	Y
Manifest Tracking Number:	015217860FLE
Waste Line Number:	2
U.S. DOT Hazardous Indicator:	Y
U.S. DOT ID Number:	UN1719
U.S. DOT Description:	Un1719, Waste Caustic Alkali Liquids, N.O.S. (Sodium Hydroxide, Potassium Hydroxide), 8, Pg Ii
Non-Hazardous Waste Description:	Not reported
Number of Containers:	1
Container Type Code:	CF
Container Type Description:	Fiber or plastic boxes, cartons, cases
Waste Quantity:	25
Quantity Unit of Measure Code:	P
Quantity Unit of Measure Description:	Pounds
Waste Quantity, in Tons:	0.0125
Acute Waste Quantity, in Tons:	0
Non-Acute Waste Quantity, in Tons:	0.0125
Waste Quantity, in Kilograms:	11.337875
Acute Waste Quantity, in Kilograms:	0
Non-Acute Waste Quantity, in Kilorgrams:	11.337875
Management Method Code:	H040
Management Method Description:	INCINERATION
Waste Residue Indicator:	N
Quantity Discrepancy Indicator:	N
Waste Type Discrepancy Indicator:	N
Waste Density:	Not reported
Waste Density Unit of Measure Code:	Not reported
Waste Density Unit of Measure Description:	Not reported
Form Code:	Not reported
Form Code Description:	Not reported
Source Code:	Not reported
Source Code Description:	Not reported
Waste Minimization Code:	Not reported
Waste Minimization Code Description:	Not reported
Consent Number:	Not reported
EPA Waste Indicator:	Y

T100 **ONONDAGA COUNTY WAR MEMORIAL** **PA MANIFEST** **S109246816**
NNW **515 MONTGOMERY STREET** **N/A**
1/8-1/4 **SYRACUSE, NY**
0.239 mi.
1262 ft. **Site 2 of 4 in cluster T**

Relative: **Lower**
Actual: **395 ft.**

PA MANIFEST:

Name:	ONONDAGA COUNTY WAR MEMORIAL
Address:	515 MONTGOMERY STREET
City,State,Zip:	SYRACUSE, NY
Year:	2007
Manifest Number:	000885669FLE
Manifest Type:	Not reported
Generator EPA ID:	NYD986905974
Generator Date:	12/07/2007

ONONDAGA COUNTY WAR MEMORIAL (Continued) **S109246816**

Mailing Address:	Not reported
Contact Name:	MARK H FITZGIBBONS
Contact Phone:	315-435-8043
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D008
Container Number:	4
Container Type:	DM
Waste Quantity:	800
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

T101 **ONONDAGA COUNTY WAR MEMORIAL** **RCRA-SQG** **1000446850**
NNW **515 MONTGOMERY ST** **FINDS** **NYD986905974**
1/8-1/4 **SYRACUSE, NY 13202** **ECHO**
0.239 mi.
1262 ft. **Site 3 of 4 in cluster T**

Relative: **Lower**
Actual: **395 ft.**

RCRA Listings:

Date Form Received by Agency:	20080320
Handler Name:	Onondaga County War Memorial
Handler Address:	Montgomery St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYD986905974
Contact Name:	MARK H FITZGIBBONS
Contact Address:	S STATE ST
Contact City,State,Zip:	SYRACUSE, NY 13202-3017
Contact Telephone:	315-435-8043
Contact Fax:	Not reported
Contact Email:	M_FITZGIBBONS@ONCENTER.ORG
Contact Title:	Not reported
EPA Region:	02
Land Type:	County
Federal Waste Generator Description:	Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	S STATE ST
Mailing City,State,Zip:	SYRACUSE, NY 13202-3017
Owner Name:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No

ONONDAGA COUNTY WAR MEMORIAL (Continued) **1000446850**

Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D008
Waste Description:	Lead

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: ONONDAGA COUNTY	
Legal Status:	County
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

ONONDAGA COUNTY WAR MEMORIAL (Continued) **1000446850**

Owner/Operator Indicator: Operator
Owner/Operator Name: ONONDAGA COUNTY
Legal Status: County
Date Became Current: 19921001
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: ONONDAGA COUNTY
Legal Status: County
Date Became Current: 19921001
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 19990708
Handler Name: ONONDAGA COUNTY WAR MEMORIAL
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: ONONDAGA COUNTY WAR MEMORIAL
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080320
Handler Name: ONONDAGA COUNTY WAR MEMORIAL
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No

ONONDAGA COUNTY WAR MEMORIAL (Continued) **1000446850**

Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19900626
Handler Name: ONONDAGA COUNTY WAR MEMORIAL
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080321
Handler Name: ONONDAGA COUNTY WAR MEMORIAL
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 53119
NAICS Description: LESSORS OF OTHER REAL ESTATE PROPERTY

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110004449268

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

ONONDAGA COUNTY WAR MEMORIAL (Continued) **1000446850**

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1000446850
Registry ID:	110004449268
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110004449268
Name:	ONONDAGA COUNTY WAR MEMORIAL
Address:	515 MONTGOMERY ST
City,State,Zip:	SYRACUSE, NY 13202

T102 **ONONDAGA COUNTY OF** **NY MANIFEST** **S117562840**
NNW **515 MONTGOMERY ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.239 mi.
1262 ft. **Site 4 of 4 in cluster T**

Relative: **Lower**

Actual: **395 ft.**

NY MANIFEST:

EPA ID:	NYD986905974
Country:	USA
Name:	ONONDAGA COUNTY OF
Address:	515 MONTGOMERY ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202-2918
Zip 4:	Not reported
Location Address 1:	CIVIC CTR 13TH FLOOR 421
Location Address 2:	Not reported
Location City,State,Zip:	MONTGOMERY ST. SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	ONONDAGA COUNTY OF
Mailing Contact:	MICHAEL CUNNINGHAM
Mailing Address 1:	CIVIC CTR 13TH FLOOR 421
Mailing Address 2:	Not reported
Mailing City,State,Zip:	MONTGOMERY ST. SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154352630

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	VTR000500090
Year:	2018
Trans2 State ID:	NYD980761191
Generator Ship Date:	12/07/2007
Trans1 Recv Date:	12/07/2007
Trans2 Recv Date:	12/14/2007
TSD Site Recv Date:	12/14/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986905974
Trans1 EPA ID:	Not reported

ONONDAGA COUNTY OF (Continued) **S117562840**

Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	000885669FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	LEAD
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	800
Units:	Pounds
Number of Containers:	4
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	NYB2978244
Manifest Status:	Not reported
Trans1 State ID:	DT52451
Year:	1990
Trans2 State ID:	Not reported
Generator Ship Date:	11/19/1990
Trans1 Recv Date:	11/19/1990
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/26/1990
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986905974
Trans1 EPA ID:	MOD095038998
Trans2 EPA ID:	Not reported
TSDF ID 1:	KSD980964993
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported

ONONDAGA COUNTY OF (Continued) **S117562840**

Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B006
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00863
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Landfill
Specific Gravity:	01.00
Waste Code 7:	B001
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00771
Units:	Kilograms
Number of Containers:	004
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	B007
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00096
Units:	Kilograms
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	01.00

V103 **1045-1047 SOUTH SALINA STREET** **US BROWNFIELDS** **1016352211**
SSW **1045 SOUTH SALINA STREET** **FINDS** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.247 mi.
1305 ft. **Site 2 of 3 in cluster V**

Relative: **Lower**
Actual: **391 ft.**

US BROWNFIELDS:

Name:	1045-1047 SOUTH SALINA STREET
Address:	1045 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	14742
Property Alias:	Not reported
Recipient Name:	Syracuse, City of
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	Not reported
Latitude:	43.037258

1045-1047 SOUTH SALINA STREET (Continued) **1016352211**

Longitude:	-76.149513
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BP
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98229401
Start Date:	9/30/2002
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	9/30/2002
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Not reported
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	U
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported

1045-1047 SOUTH SALINA STREET (Continued) **1016352211**

Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2633
Below Poverty Percent:	54.14
Meidan Income:	1562
Meidan Income Number:	3682
Meidan Income Percent:	75.71
Vacant Housing Number:	281
Vacant Housing Percent:	14.52
Unemployed Number:	369
Unemployed Percent:	7.59

1045-1047 SOUTH SALINA STREET (Continued) **1016352211**

FINDS:
Registry ID: 110039546934

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

---

104 North 1/4-1/2 0.252 mi. 1329 ft. **SPILL NUMBER 8601815** **NY LTANKS** **S104619136**
600 S. STATE ST @ CIVIC CTR. **N/A**
SYRACUSE, NY

Relative: Lower
Actual: 397 ft.

LTANKS:

Name:	SPILL NUMBER 8601815
Address:	600 S. STATE ST @ CIVIC CTR.
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8601815 / 1988-01-15
Facility ID:	8601815
Site ID:	137258
Spill Date:	1986-06-16
Spill Cause:	Tank Overfill
Spill Source:	Tank Truck
Spill Class:	Not reported
Cleanup Ceased:	1988-01-15
SWIS:	3415
Investigator:	UNASSIGNED
Referred To:	Not reported
Reported to Dept:	1986-06-16
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1986-07-09
Spill Record Last Update:	1995-01-03
Spiller Name:	Not reported
Spiller Company:	SEARS OIL
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	117430
Latitude:	43.0459313
Longitude:	-76.1481576
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was UK

SPILL NUMBER 8601815 (Continued) **S104619136**

Remarks: SPILLER TO CLEANUP

All Materials:

Site ID:	137258
Operable Unit ID:	899258
Operable Unit:	01
Material ID:	559760
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	50.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

W105 **HARRISON PARKING GARAGE** **NY LTANKS** **S105054356**
NW **WARREN & HARRISON ST** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.256 mi.
1351 ft. **Site 2 of 3 in cluster W**

Relative: **Lower**

Actual: **392 ft.**

LTANKS:

Name:	HARRISON PARKING GARAGE
Address:	WARREN & HARRISON ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9010749 / 1999-11-26
Facility ID:	9010749
Site ID:	121632
Spill Date:	1991-01-05
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	VOLLMER
Referred To:	Not reported
Reported to Dept:	1991-01-08
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1991-01-13
Spill Record Last Update:	1999-11-26
Spiller Name:	Not reported
Spiller Company:	HARRISON PARK GARAGE CORP
Spiller Address:	SUITE 702 - MONY TOWER 2
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7

HARRISON PARKING GARAGE (Continued) **S105054356**

DER Facility ID:	105583
Latitude:	43.0443049
Longitude:	-76.1508540
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was DV 04/10/91: OPTIONS FOR ON SITE REMEDIATION OF SOIL UNDER STUDY. 02/28/92: PAASIVE SOIL VENT TO BE INCLUDED IN FINAL CONSTRUCTION PHASE.
Remarks:	CONTAMINATED SOIL DISCOVERED WHEN EXCAVATING FOR NEW PARKING GARAGE.

All Materials:

Site ID:	121632
Operable Unit ID:	947890
Operable Unit:	01
Material ID:	562056
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

W106 **HARRISON PARKING GARAGE** **UST FINDER RELEASE** **1029056971**
NW **WARREN & HARRISON ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.256 mi.
1351 ft. **Site 3 of 3 in cluster W**

Relative: **Lower**
Actual: **392 ft.**

UST FINDER RELEASE:

Object ID:	249457
Facility ID:	NY105583
Lust ID:	NY9010749
Name:	HARRISON PARKING GARAGE
Address:	WARREN & HARRISON ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1991/01/05 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1512
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2

HARRISON PARKING GARAGE (Continued) **1029056971**

NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1508499999999
Y Coord:	43.0443000000001
Latitude:	43.0443
Longitude:	-76.15085

V107 **1049-1071 SOUTH SALINA STREET** **US BROWNFIELDS** **1016352214**
SSW **1049-1071 SOUTH SALINA STREET** **FINDS** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.263 mi.
1391 ft. **Site 3 of 3 in cluster V**

Relative: **Lower**
Actual: **390 ft.**

US BROWNFIELDS:

Name:	1049-1071 SOUTH SALINA STREET
Address:	1049-1071 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	14743
Property Alias:	Not reported
Recipient Name:	Syracuse, City of
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	Not reported
Latitude:	43.037208
Longitude:	-76.149506
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BP
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98229401
Start Date:	9/30/2002
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	9/30/2002
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Not reported

1049-1071 SOUTH SALINA STREET (Continued) **1016352214**

Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	U
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N

1049-1071 SOUTH SALINA STREET (Continued) **1016352214**

Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2563
Below Poverty Percent:	55.02
Meidan Income:	1562
Meidan Income Number:	3603
Meidan Income Percent:	77.35
Vacant Housing Number:	276
Vacant Housing Percent:	14.66
Unemployed Number:	366
Unemployed Percent:	7.86

FINDS:
Registry ID: 110039546961

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

X108 **RENALLI TAYLOR ST LLC** **NY LTANKS** **1000311573**
SW **140 CORTLAND AVE** **NY CBS** **NYD013250618**
1/4-1/2 **SYRACUSE, NY 13202** **NY CBS AST**
0.279 mi. **NY BROWNFIELDS**
1473 ft. **Site 1 of 2 in cluster X** **NY Spills**
RCRA NonGen / NLR
Relative: Lower **ICIS**
US AIRS
Actual: 390 ft. **FINDS**
ECHO
PFAS ECHO
NY DRYCLEANERS
RI MANIFEST
NY MANIFEST

LTANKS:
Name: COYNE TEXTILE
Address: 140 CORTLAND AVE

RENALLI TAYLOR ST LLC (Continued) **1000311573**

City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9604373 / 1996-07-02
Facility ID:	9604373
Site ID:	156885
Spill Date:	1996-07-01
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	D5
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1996-07-01
CID:	282
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1996-07-01
Spill Record Last Update:	1996-07-03
Spiller Name:	SAME
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	DJ SMITH
Spiller Phone:	(315) 475-1626
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	132732
Latitude:	43.0372833
Longitude:	-76.1502534
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM CLOSE SPILL REFER TO DIV. OF WATER.
Remarks:	waste water sludge is the spill it went on to the road and went into a storm drain.

All Materials:

Site ID:	156885
Operable Unit ID:	1032027
Operable Unit:	01
Material ID:	350664
Material Code:	0064A
Material Name:	unknown material
Case No.:	Not reported
Material FA:	Other
Quantity:	10.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

CBS:

Name:	COYNE TEXTILE SERVICES

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Address:	140 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY 13202
CBS Number:	7-000217
Program Type:	CBS
Facility Status:	Active
Expiration Date:	08/19/2017
Dec Region:	7
UTMX:	406264.72814
UTMY:	4765538.10119

CBS AST:

CBS Number:	7-000217
ICS Number:	7-178107
PBS Number:	7-072842
MOSF Number:	Not reported
SPDES Number:	Not reported
Facility Status:	IN SERVICE
Facility Type:	I
Telephone:	(315) 475-1626
Facility Town:	SYRACUSE (C)
Region:	STATE
Expiration Date:	08/19/2001
Total Capacity of All Active Tanks(gal):	883
Operator:	JIM BARNES
Emergency Contact:	D.J. SMITH
Emergency Phone:	(315) 475-1626
Owner Name:	COYNE TEXTILE SERVICES
Owner Address:	140 CORTLAND AVENUE
Owner City,St,Zip:	SYRACUSE, NY 13202
Owner Telephone:	(315) 475-1626
Owner Type:	Corporate/Commercial
Owner Sub Type:	Not reported
Mail Name:	COYNE TEXTILE SERVICES
Mail Contact Addr:	140 CORTLAND AVENUE
Mail Contact Addr2:	PO BOX 4854
Mail Contact Contact:	D.J. SMITH
Mail Contact City,St,Zip:	SYRACUSE, NY 13202
Mail Phone:	(315) 475-1626

Tank Id:	006
CAS Number:	7705080
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	11/95
Tank Closed:	Not reported
Capacity (Gal):	437
Chemical:	Ferric chloride
Tank Location:	Indoors, Aboveground
Tank Type:	Fiberglass reinforced plastic [FRP]
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	01/11/1999
Certified Date:	07/09/1999
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None

RENALLI TAYLOR ST LLC (Continued) **1000311573**

External Protection:	None
Pipe Location:	Aboveground
Pipe Type:	Double Walled Fiberglass
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Pipe Flag:	Painted/Asphalt Coating
Leak Detection:	None
Overfill Protection:	None
Haz Percent:	50
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	43|02| / 76|09|
Is Updated:	False
Renew Date:	09/27/93
Is It There:	False
Delinquent:	False
Date Expired:	08/19/93
Owner Mark:	1
Certificate Needs to be Printed:	43|02| / 76|09|
Fiscal Amt for Registration Fee Correct:	43|02| / 76|09|
Renewal Has Been Printed for Facility:	43|02| / 76|09|
Pre-Printed Renewal App Last Printed:	43|02| / 76|09|

Tank Id:	002
CAS Number:	1330207
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	11/91
Tank Closed:	00/00
Capacity (Gal):	5000
Chemical:	Xylene (mixed)
Tank Location:	Indoors, Belowground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	12/22/1993
Certified Date:	07/09/1999
Substance:	More than one Hazardous Substance on DEC List
Internal Protection:	Epoxy Liner
External Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Galvanized Steel
Pipe Internal:	None
Pipe External:	Wrapped (Piping
Pipe Flag:	Wrapped (Piping
Leak Detection:	Concrete Pad w/channels
Overfill Protection:	Catch Basin
Haz Percent:	10
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	43|02| / 76|09|
Is Updated:	False

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Renew Date:	09/27/93
Is It There:	False
Delinquent:	False
Date Expired:	08/19/93
Owner Mark:	1
Certificate Needs to be Printed:	43|02| / 76|09|
Fiscal Amt for Registration Fee Correct:	43|02| / 76|09|
Renewal Has Been Printed for Facility:	43|02| / 76|09|
Pre-Printed Renewal App Last Printed:	43|02| / 76|09|

Tank Id:	003
CAS Number:	1330207
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	11/91
Tank Closed:	00/00
Capacity (Gal):	5000
Chemical:	Xylene (mixed)
Tank Location:	Indoors, Belowground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	12/22/1993
Certified Date:	07/09/1999
Substance:	More than one Hazardous Substance on DEC List
Internal Protection:	Epoxy Liner
External Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Galvanized Steel
Pipe Internal:	None
Pipe External:	Wrapped (Piping
Pipe Flag:	Wrapped (Piping
Leak Detection:	Concrete Pad w/channels
Overfill Protection:	Catch Basin
Haz Percent:	10
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	43|02| / 76|09|
Is Updated:	False
Renew Date:	09/27/93
Is It There:	False
Delinquent:	False
Date Expired:	08/19/93
Owner Mark:	1
Certificate Needs to be Printed:	43|02| / 76|09|
Fiscal Amt for Registration Fee Correct:	43|02| / 76|09|
Renewal Has Been Printed for Facility:	43|02| / 76|09|
Pre-Printed Renewal App Last Printed:	43|02| / 76|09|

Tank Id:	004
CAS Number:	7664939
Federal ID:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Tank Status:	In Service
Install Date:	07/93
Tank Closed:	01/99
Capacity (Gal):	220
Chemical:	Sulfuric acid
Tank Location:	Indoors, Aboveground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	None
Tank Error Status:	No Missing Data
Date Entered:	12/22/1993
Certified Date:	07/09/1999
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Double Walled Fiberglass
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Pipe Flag:	Painted/Asphalt Coating
Leak Detection:	None
Overfill Protection:	Catch Basin
Haz Percent:	98
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	43|02| / 76|09|
Is Updated:	False
Renew Date:	09/27/93
Is It There:	False
Delinquent:	False
Date Expired:	08/19/93
Owner Mark:	1
Certificate Needs to be Printed:	43|02| / 76|09|
Fiscal Amt for Registration Fee Correct:	43|02| / 76|09|
Renewal Has Been Printed for Facility:	43|02| / 76|09|
Pre-Printed Renewal App Last Printed:	43|02| / 76|09|

Tank Id:	001
CAS Number:	127184
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	07/91
Tank Closed:	00/00
Capacity (Gal):	275
Chemical:	Tetrachloroethylene
Tank Location:	Indoors, Aboveground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	00
Tank Error Status:	No Missing Data
Date Entered:	08/13/1991
Certified Date:	07/09/1999
Substance:	Single Hazardous Substance on DEC List

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Internal Protection:	None
External Protection:	None,Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	01
Pipe Flag:	01
Leak Detection:	00
Overfill Protection:	04
Haz Percent:	99
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	43|02| / 76|09|
Is Updated:	False
Renew Date:	09/27/93
Is It There:	False
Delinquent:	False
Date Expired:	08/19/93
Owner Mark:	1
Certificate Needs to be Printed:	43|02| / 76|09|
Fiscal Amt for Registration Fee Correct:	43|02| / 76|09|
Renewal Has Been Printed for Facility:	43|02| / 76|09|
Pre-Printed Renewal App Last Printed:	43|02| / 76|09|

Tank Id:	005
CAS Number:	7664939
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	01/92
Tank Closed:	Not reported
Capacity (Gal):	446
Chemical:	Sulfuric acid
Tank Location:	Indoors, Aboveground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	12/22/1993
Certified Date:	07/09/1999
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Double Walled Fiberglass
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Pipe Flag:	Painted/Asphalt Coating
Leak Detection:	None
Overfill Protection:	None
Haz Percent:	98
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	43|02| / 76|09|

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Is Updated:	False
Renew Date:	09/27/93
Is It There:	False
Delinquent:	False
Date Expired:	08/19/93
Owner Mark:	1
Certificate Needs to be Printed:	43|02| / 76|09|
Fiscal Amt for Registration Fee Correct:	43|02| / 76|09|
Renewal Has Been Printed for Facility:	43|02| / 76|09|
Pre-Printed Renewal App Last Printed:	43|02| / 76|09|

BROWNFIELDS:

Name:	FORMER COYNE TEXTILE - OFF-SITE
Address:	140 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	580830
Acres:	Not reported
HW Code:	C734144A
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	12/27/2018
Record Updated Date:	02/27/2024
Update By:	GWPRISCO
Site Description:	"Location: The on-site portion is located in an urban area at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous Site areas. The former main laundry facility and offices are known as 140 Cortland Avenue (Tax Map No. 094.-05-06.0) and consist of one parcel of land totaling approximately 1.75 acres. The park and employee parking area are known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street and consists of two parcels totaling approximately 1.70 acres. The on-site limits are generally bound by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and South Clinton Street to the west. The off-site portion that currently needs investigation is approximately 8.5 acres located mainly to the west of the on-site portion. Site Features: 140 Cortland Ave. consists of the currently vacant former laundering facility and offices, sidewalks and limited vegetation. The building is a concrete block building with a slab-on-grade foundation. The other area consists of a small park and a fenced in asphalt parking lot. The off-site area is relatively flat and there are several buildings with both industrial and commercial use space. The area also consists of multiple parking lots and some green space. Current Zoning and Land Use: The on-site portion of the site is currently inactive and is zoned for commercial use. The off-site area is zoned for commercial and industrial use. Several rows of multifamily houses are located west of the area. Past Use of the Site: The 140 Cortland Avenue property was owned by various entities of Coyne Textile Services since the mid-1930s and was utilized as an industrial laundry prior to the company filing for bankruptcy and ceasing operations in late 2015. Dry cleaning using PCE and Stoddard solvent (a petroleum mixture made from distilled alkanes, cycloalkanes (naphthenes) and aromatic compounds) was conducted at the property until 2000. These dry cleaning products were stored in aboveground storage tanks (ASTs). Three underground storage tanks (USTs) were historically closed in place and were identified as being

RENALLI TAYLOR ST LLC (Continued) **1000311573**

located beneath the dry cleaning room floor and the boiler room at 140 Cortland Avenue. A gasoline filling station was present in the southern portion of the Site in the 1980s. Prior to the Site being developed by Coyne Textile Services in the 1930s, the Site and surrounding area consisted primarily of single family residences. The former employee parking lot and park located east of the former laundering facility was owned by Coyne Textile Services from 1989-2015. Since 1989 this area was utilized as a parking lot and park. Historically, a building was utilized by the Syracuse Transit Corporation Bus Lines on the southern portion of the parking lot for bus storage and repairs from at least the 1940s to 1980s. The Syracuse Street Car barn also occupied this area in the early 1900s. The northern portion of the former employee parking lot and park was occupied by small stores in the early 1900s and a gasoline filling station was present on this portion of the parcel from at least the 1950s to 1970s. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. purchased the property in 2016 and entered a BCA in September 2017. The past use of most of the off-site area is currently unknown. But some of the area was used by Coyne Textile Services to park and maintain their truck fleet. Another portion of the area was used to manufacture garage door parts, faucets, and inked ribbon spools, clips and strips. Site Geology and Hydrogeology: Both the on-site and off-site areas sites have an approximate elevation of 390 feet above mean sea level and are relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient which slopes downward to Onondaga Creek. Soils consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the Site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The estimated depth to groundwater is less than 20 feet below ground surface. Groundwater at the sites is assumed to flow to the west toward Onondaga Creek. However, localized flow directions in the area of the sites may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the on-site portion, which flows in a northerly direction towards Onondaga Lake."

Env Problem:

"Nature and Extent of Contamination: On-site soil and groundwater were analyzed for volatile organic compounds (VOCs), semi-volatile compounds (SVOCs), metals, polychlorinated biphenyls (PCBs), and pesticides. Groundwater was also sampled for Emerging Contaminants (ECs). Soil vapor was analyzed for VOCs. Based upon investigations conducted to date, the primary contaminants of concern appear to be VOCs and metals with minor detection’s of ECs, PCBs, and SVOCs. No off-site samples were taken during the on-site Remedial Investigation. However, there is some off-site groundwater data. See the Groundwater section below. Soil Surface Soils: Only one VOC, acetone, was detected in the surface soil sample collected from Coyne Park at a concentration of 0.427 ppm which exceeds the Part 375 Unrestricted SCO of 0.05 ppm but is less than the Part 375 Commercial SCO of 500 ppm. SVOCs, PCBs, metals, and pesticides contamination were not identified in the surface soil sample. There is currently no off-site surface soil data. Subsurface Soils: Only one VOC, Tetrachloroethene (PCE), was detected at a concentration exceeding the Part 375 Commercial SCO of 150 milligram per kilogram (mg/kg). The PCE concentration is 460mg/kg and this sample was located in the NW corner of the on-site building. There are several other compounds

RENALLI TAYLOR ST LLC (Continued) **1000311573**

including 1,1- Dichloroethene at a maximum of 1.45mg/kg, 1,2,4 Trimethylbenzene at a maximum of 4.31mg/kg, 2-Butanone (MEK) at a maximum of 0.115mg/kg, trichloroethene at a maximum of 38.3mg/kg, vinyl chloride at a maximum of 12.3mg/kg, cis-1,2-Dichloroethene at a maximum of 424mg/kg, trans-1,2-Dichloroethene at a maximum of 3.46mg/kg, acetone at a maximum of 5.9mg/kg, and Benzene at a maximum of 0.39mg/kg, that were detected above Part 375 Unrestricted SCOs. SVOCs detected at concentrations exceeding their respective Part 375 Unrestricted SCOs, but below Part 375 Commercial SCOs, include benzo(a)anthracene at a maximum of 2.42mg/kg, Benzo(a)pyrene at a maximum of 2.28mg/kg, Benzo(b)fluoranthene at a maximum of 3.06mg/kg, Benzo(k)fluoranthene at a maximum of 1.64mg/kg, Chrysene at a maximum of 2.42mg/kg, and Indeno(1,2,3-cd)pyrene at a maximum of 0.79mg/kg. No SVOCs were detected at concentrations exceeding the Part 375 Commercial SCOs. Pesticides were not detected in any of the subsurface samples. PCBs, including Aroclor 1242 and Aroclor 1260 were detected at concentrations above their respective Part 375 Unrestricted SCO of 0.1 mg/kg, but below the Part 375 Commercial SCO. The maximum Total PCBs concentration was 0.74 mg/kg. Low concentrations of metals were found across the on-site area. Barium was detected at a concentration of 404 mg/kg, which exceeds the Part 375 Commercial SCO of 400 mg/kg. However, this value was qualified, by Pace, with a JH qualifier. This sample was located near the location of the former folding/product storage area. Several other metals were detected above unrestricted SCOs including copper at a maximum of 114mg/kg, lead at a maximum of 776mg/kg, nickel at a maximum of 56.2mg/kg, zinc at a maximum of 315mg/kg, and mercury at a maximum of 1.4mg/kg. No offsite soil samples were taken during the RI however some off-site subsurface soils were sampled in 2015. Off-site subsurface soil data shows four SVOCs above Industrial SCOs in MW-4 at a depth of 8-10 feet. These SVOCs are Benzo(a)anthracene at a maximum of 20 mg/kg, Benzo(a)pyrene at a maximum of 17 mg/kg, Benzo(b)fluoranthene at a maximum of 21 mg/kg, and Dibenzo(a,h)anthracene at a maximum of 2.4 mg/kg. No other contaminants were above industrial SCOs. Groundwater (GW) No PCBs or Pesticides were detected within the groundwater. VOCs detected in groundwater above the GW standard include 1,1-Dichloroethene at a maximum of 18ug/kg, benzene at a maximum of 104ug/kg, isopropylbenzene (Cumene) at a maximum of 121ug/kg, tetrachloroethene at a maximum of 21,400ug/kg, trichloroethene at a maximum of 1,980ug/kg, vinyl chloride at a maximum of 1,560ug/kg, xylene (Total) at a maximum of 6.3ug/kg, cis-1,2-Dichloroethene at a maximum of 4,550ug/kg, and trans-1,2-Dichloroethene at a maximum of 27.5ug/kg. Most of the VOC GW impacts were located in the NW portion of the on-site building but VOC impacts were detected throughout the site. Only one SVOC exceeded GW standards and that was bis(2-Ethylhexyl)phthalate at a maximum of 11ug/kg. This was located in the NW portion of the on-site building. Metals that exceeded the GW standards include barium at a maximum of 2.940ug/kg, beryllium at a maximum of 7ug/kg, chromium at a maximum of 55ug/kg, copper at a maximum of 1,120ug/kg, lead at a maximum of 27ug/kg, magnesium at a maximum of 204,000ug/kg, and thallium at a maximum of 14.5ug/kg. Metals within the GW were detected throughout the whole site. ECs detected in the GW include 6:2FTS at a maximum of 33ng/kg, Perfluorobutanesulfonic acid (PFBS) at a maximum of 14ng/kg, Perfluorobutanoic acid (PFBA) at a maximum of 330ng/kg, Perfluorodecanoic acid (PFDA) at a maximum of 2.1ng/kg,

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Perfluoroheptanesulfonic Acid (PFHpS) at a maximum of 24ng/kg, Perfluoroheptanoic acid (PFHpA) at a maximum of 160ng/kg, Perfluorohexanesulfonic acid (PFHxS) at a maximum of 25ng/kg, Perfluorohexanoic acid (PFHxA) at a maximum of 350ng/kg, Perfluorononanoic acid (PFNA) at a maximum of 75ng/kg, Perfluorooctanesulfonic acid (PFOS) at a maximum of 2,000ng/kg, Perfluorooctanoic acid (PFOA) at a maximum of 300ng/kg, Perfluoropentanoic acid (PFPeA) at a maximum of 360ng/kg, and 1,4-Dioxane at a maximum of 1.7ng/kg. Most of the ECs were detected in the NW portion of the on-site building. No off-site wells were sampled during the remedial investigation. However, off-sites wells were sampled previously in 2015. There are 4 monitoring wells off-site located to the northwest of the on-site area. Each of these wells have contaminants that exceed NYSDEC TOGS 1.1.1 water quality standards and guidance values. The following contaminants were detected above the GW standards at one or more of the wells: Tetrachloroethene at a maximum of 3100ug/L, benzene at a maximum of 4.4ug/L, vinyl chloride at a maximum of 3200ug/L, trans-1,2-dichloroethene at a maximum of 230ug/L, Trichloroethene at a maximum of 2000ug/L, cis-1,2-dichloroethene at a maximum of 5600ug/kg, and 1,1-Dichloroethene at a maximum of 15ug/L. Soil Vapor Soil vapor detection's that need additional action were detected all throughout the on-site building. Compounds detected needing additional action include: 1,1,1 - Trichloroethane at a maximum of 5.3ug/m3, Tetrachloroethene at a maximum of 1,090ug/m3, Trichloroethene at a maximum of 106ug/m3, and cis-1,2-Dichloroethene at a maximum of 38.4ug/m3. There is currently no off-site soil vapor data. "

Health Problem: "Volatile organic compounds in groundwater or soil vapor originating from the Former Coyne Textile site (C734144) may move off-site into overlying buildings and affect indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Investigations are needed to determine if soil vapor intrusion is a potential concern for these off-site buildings."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2019-01-02 13:58:00
Record Upd: 2019-01-02 13:58:00
Updated By: MJBELVEG
Own Op: Not reported
Sub Type: Not reported
Owner Name: Not reported
Owner Company: Not reported
Owner Address: Not reported
Owner Addr2: Not reported
Owner City,St,Zip: Not reported
Owner Country: Not reported
HW Code: C734144A
Waste Type: benzo(a)pyrene

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	benzo(b)fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	dibenz[a,h]anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	benzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	trans-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	cis-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	1,1 dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	trichloroethene (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	vinyl chloride
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	benzo(a)anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	C734144
Cross Ref Type Code:	22
Cross Ref Type:	BCP Site ID
Record Added Date:	2019-01-02 13:56:00
Record Updated:	2019-01-02 13:56:00
Updated By:	MJBELVEG

SPILLS:

Name:	COMMERCIAL BUILDING (COYNE TEXTILE)
Address:	140 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	0905092 / 2010-01-12
Facility ID:	0905092
Facility Type:	ER
DER Facility ID:	366482

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Site ID:	417341
DEC Region:	7
Spill Cause:	Housekeeping
Spill Class:	C6
SWIS:	3415
Spill Date:	2009-08-01
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2009-08-01
CID:	Not reported
Water Affected:	ONONDAGA CREEK
Spill Source:	Non Major Facility > 1,100 gal
Spill Notifier:	Fire Department
Cleanup Ceased:	2009-08-03
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-08-01
Spill Record Last Update:	2010-01-12
Spiller Name:	Not reported
Spiller Company:	COYNE TEXTILE
Spiller Address:	140 CORTLAND AVE
Spiller Company:	999
Contact Name:	CHIEF DUFFY
Latitude:	43.0372665
Longitude:	-76.1502757
DEC Memo:	FD advised 2 40 CY ISO containers caught fire due to suspected spontaneous combustion of oily rags stored inside. FD used several thousand gallons of water to extinguish fire, causing oily surface water to flow into area storm drains. Awaiting FD report from Lt. Galloway.
Remarks:	2 large containers found with rags soaked with engine oil,cooking oil,auto grease, and printer ink caught on fire.Request DEC call back. Not reported

All Materials:

Site ID:	417341
Operable Unit ID:	1173560
Operable Unit:	01
Material ID:	2165500
Material Code:	0046A
Material Name:	cooking grease
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Soil, Surface Water
Oxygenate:	Not reported

Site ID:	417341
Operable Unit ID:	1173560
Operable Unit:	01
Material ID:	2165501
Material Code:	0064A

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Material Name:	unknown material
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Soil, Surface Water
Oxygenate:	Not reported

Name:	COYNE TEXTILE SERVICES
Address:	140 CORTLAND ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9909798 / 1999-11-30
Facility ID:	9909798
Facility Type:	ER
DER Facility ID:	65005
Site ID:	68200
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	1999-11-12
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1999-11-12
CID:	211
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1999-11-12
Spill Record Last Update:	2000-02-15
Spiller Name:	D J SMITH
Spiller Company:	COYNE TEXTILE SERVICES
Spiller Address:	140 CORTLAND ST
Spiller Company:	001
Contact Name:	D J SMITH
Latitude:	43.0032540
Longitude:	-76.1513400
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	2 CAUSES FAILED LEVEL CONTROL VALVE AND OVER FLOW PIPE BROKE - SPILL CLEANED UP

All Materials:

Site ID:	68200
Operable Unit ID:	1088487
Operable Unit:	01
Material ID:	298867
Material Code:	0060A
Material Name:	wastewater
Case No.:	Not reported
Material FA:	Other

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Quantity:	100.00
Units:	G
Recovered:	100.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	COYNE TEXTILE SERVICES
Address:	140 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0301230 / 2003-05-05
Facility ID:	0301230
Facility Type:	ER
DER Facility ID:	132732
Site ID:	101722
DEC Region:	7
Spill Cause:	Other
Spill Class:	C6
SWIS:	3415
Spill Date:	2003-05-04
Investigator:	MENASH
Referred To:	Not reported
Reported to Dept:	2003-05-04
CID:	365
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2003-05-04
Spill Record Last Update:	2003-05-05
Spiller Name:	DJ SMITH
Spiller Company:	COYNE TEXTILE SERVICES
Spiller Address:	140 CORTLAND AV
Spiller Company:	001
Contact Name:	DJ SMITH
Latitude:	43.0372833
Longitude:	-76.1502534
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MN SPILL TURNED OVER TO WATER DEPT.
Remarks:	spontainious heating caused a fire in the facility - the fire dept responded - oils inks & blanket wash & water put on the fire by fd were washed down the storm sewer

All Materials:

Site ID:	101722
Operable Unit ID:	867623
Operable Unit:	01
Material ID:	571447
Material Code:	0064A
Material Name:	unknown material
Case No.:	Not reported
Material FA:	Other

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Quantity:	1200.00
Units:	G
Recovered:	.00
Resource Affected:	Sewer
Oxygenate:	Not reported

Name:	CONSTRUCTION SITE
Address:	140 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2005960 / 2020-10-29
Facility ID:	2005960
Facility Type:	ER
DER Facility ID:	132732
Site ID:	611773
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	3415
Spill Date:	2020-09-30
Investigator:	MJBELVEG
Referred To:	Not reported
Reported to Dept:	2020-10-01
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2020-10-01
Spill Record Last Update:	2020-10-29
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	KARYN MEHMANN
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	cleanup pending brownfield cleanup number c734144

All Materials:

Site ID:	611773
Operable Unit ID:	1358921
Operable Unit:	01
Material ID:	2370364
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Groundwater

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Oxygenate: Not reported

RCRA Listings:

Date Form Received by Agency:	20160302
Handler Name:	Coyne Textile Services
Handler Address:	Cortland Ave
Handler City,State,Zip:	SYRACUSE, NY 13221
EPA ID:	NYD013250618
Contact Name:	JOHN D WESSELS
Contact Address:	CORTLAND AVE
Contact City,State,Zip:	SYRACUSE, NY 13221
Contact Telephone:	315-475-1626
Contact Fax:	315-475-0057
Contact Email:	JOHN.WESSELS@COYNETEXTILESERVICES.COM
Contact Title:	CORPORATE ENVIRONMENTAL AFFAIRS
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	CORTLAND AVE
Mailing City,State,Zip:	SYRACUSE, NY 13221
Owner Name:	Coyne International Enterprises
Owner Type:	Private
Operator Name:	Coyne Textile Services
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20160323
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Biennial: List of Years
Year: 2015

Click Here for Biennial Reporting System Data:
Year: 2013

Click Here for Biennial Reporting System Data:
Year: 2011

Click Here for Biennial Reporting System Data:
Year: 2009

Click Here for Biennial Reporting System Data:
Year: 2007

Click Here for Biennial Reporting System Data:
Year: 2005

Click Here for Biennial Reporting System Data:
Year: 2003

Click Here for Biennial Reporting System Data:
Year: 2001

Click Here for Biennial Reporting System Data:

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	D008
Waste Description:	Lead
Waste Code:	D018
Waste Description:	Benzene
Waste Code:	D039
Waste Description:	Tetrachloroethylene
Waste Code:	D040
Waste Description:	Trichloroethylene

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Waste Code: F002
Waste Description: The Following Spent Halogenated Solvents: Tetrachloroethylene, Methylene Chloride, Trichloroethylene, 1,1,1-Trichloroethane, Chlorobenzene, 1,1,2-Trichloro-1,2,2-Trifluoroethane, Ortho-Dichlorobenzene, Trichlorofluoromethane, And 1,1,2, Trichloroethane; All Spent Solvent Mixtures/Blends Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Halogenated Solvents Or Those Solvents Listed In F001, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name:	COYNE TEXTILE SERVICES
Legal Status:	Private
Date Became Current:	19390524
Date Ended Current:	Not reported
Owner/Operator Address:	140 CORTLAND AVE
Owner/Operator City,State,Zip:	SYRACUSE, NY 13221
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name:	STANLEY COYNE INT ENTERPRISES CORP
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	140 CORTLAND AVE
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-475-1626
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	COYNE TEXTILE SERVICES
Legal Status:	Private
Date Became Current:	19290524
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	COYNE TEXTILE SERVICES
Legal Status:	Private
Date Became Current:	19290524
Date Ended Current:	Not reported
Owner/Operator Address:	140 CORTLAND AVE.
Owner/Operator City,State,Zip:	SYRACUSE, NY 13221
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE TEXTILE SEVICES
Legal Status: Federal
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE TEXTILE SERVICES
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES
Legal Status: Private
Date Became Current: 19390524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: 315-475-1626
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES, INC.
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES
Legal Status: Private
Date Became Current: 19390524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: 315-475-1626
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE TEXTILE SERVICES
Legal Status: Private
Date Became Current: 20021121
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE TEXTILE SEVICESCOYNE INTERNATIONAL
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: NO NAME FOUND
Legal Status: Private

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Date Became Current:	19290524
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name: COYNE TEXTILE SERVICES	
Legal Status:	Private
Date Became Current:	19290524
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name: COYNE TEXTILE SERVICES	
Legal Status:	Private
Date Became Current:	19390524
Date Ended Current:	Not reported
Owner/Operator Address:	140 CORTLAND AVE
Owner/Operator City,State,Zip:	SYRACUSE, NY 13221
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: STANLEY COYNE INT ENTERPRISES CORP	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	140 CORTLAND AVE
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-475-1626
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES, INC.	
Legal Status:	Private
Date Became Current:	19290524
Date Ended Current:	Not reported
Owner/Operator Address:	140 CORTLAND AVE.
Owner/Operator City,State,Zip:	SYRACUSE, NY 13221
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE TEXTILE SERVICES
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES, INC.
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20100219
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20120223
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20140314
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20160208
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060215
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Receive Date:	20160302
Handler Name: COYNE TEXTILE SERVICES	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	19930412
Handler Name: COYNE TEXTILE SERVICES	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20021121
Handler Name: COYNE TEXTILE SERVICES	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	19900301
Handler Name: COYNE TEXTILE SERVICES	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	19920228
Handler Name: COYNE TEXTILE	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	19940516
Handler Name:	COYNE TEXTILE SERVICES
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	19960222
Handler Name:	COYNE TEXTILE SERVICES
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	19980211
Handler Name:	COYNE TEXTILE SERVICES
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20010101
Handler Name:	COYNE TEXTILE SERVICES
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20020207
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20040216
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060216
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080126
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 812332

RENALLI TAYLOR ST LLC (Continued) **1000311573**

NAICS Description: INDUSTRIAL LAUNDERERS

Has the Facility Received Notices of Violations:

Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - General
Date Violation was Determined:	19901116
Actual Return to Compliance Date:	19910114
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19910110
Enforcement Identifier:	002
Date of Enforcement Action:	19901210
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Universal Waste - Small Quantity Handlers
Date Violation was Determined:	20070830
Actual Return to Compliance Date:	20071015
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20070920
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYJGE
Enforcement Responsible Sub-Organization: R7
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Generators - Manifest
Date Violation was Determined: 19880104
Actual Return to Compliance Date: 19880106
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 19880106
Enforcement Identifier: 001
Date of Enforcement Action: 19880104
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDEC
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:
Evaluation Date: 19901116
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19910114
Scheduled Compliance Date: 19910110
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19870910
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20120201
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier: R2OSK
Evaluation Responsible Sub-Organization: RCB
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20140812
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier: NYBRS
Evaluation Responsible Sub-Organization: R7
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20070830

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier:	NYJGE
Evaluation Responsible Sub-Organization:	R7
Actual Return to Compliance Date:	20071015
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	20030609
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier:	NYBRS
Evaluation Responsible Sub-Organization:	R7
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	20100504
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier:	NYJGE
Evaluation Responsible Sub-Organization:	R7
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	19880104
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19880106
Scheduled Compliance Date:	19880106
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	19991223
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier:	NYBRS
Evaluation Responsible Sub-Organization:	R7

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

ICIS:

Enforcement Action ID:	NY000A0000731150034200304
FRS ID:	110000807431
Action Name:	COYNE TEXTILE SERVICES 360670009900304
Facility Name:	COYNE TEXTILE SERVICES
Facility Address:	140 CORTLAND AVE SYRACUSE, NY 132023411
Enforcement Action Type:	Notice of Violation
Facility County:	ONONDAGA
Program System Acronym:	AIR
Enforcement Action Forum Desc:	Administrative - Informal
EA Type Code:	NOV
Facility SIC Code:	7218
Federal Facility ID:	Not reported
Latitude in Decimal Degrees:	43.037514
Longitude in Decimal Degrees:	-76.150328
Permit Type Desc:	Not reported
Program System Acronym:	NY0000007311500342
Facility NAICS Code:	812320
Tribal Land Code:	Not reported

Enforcement Action ID:	NY000A0000731150034200007
FRS ID:	110000807431
Action Name:	COYNE TEXTILE SERVICES 360670009900007
Facility Name:	COYNE TEXTILE SERVICES
Facility Address:	140 CORTLAND AVE SYRACUSE, NY 132023411
Enforcement Action Type:	Administrative Order
Facility County:	ONONDAGA
Program System Acronym:	AIR
Enforcement Action Forum Desc:	Administrative - Formal
EA Type Code:	SCAAAO
Facility SIC Code:	7218
Federal Facility ID:	Not reported
Latitude in Decimal Degrees:	43.037514
Longitude in Decimal Degrees:	-76.150328
Permit Type Desc:	Not reported
Program System Acronym:	NY0000007311500342
Facility NAICS Code:	812320
Tribal Land Code:	Not reported

Enforcement Action ID:	NY000A0000731150034200005
FRS ID:	110000807431
Action Name:	COYNE TEXTILE SERVICES 360670009900005
Facility Name:	COYNE TEXTILE SERVICES
Facility Address:	140 CORTLAND AVE SYRACUSE, NY 132023411
Enforcement Action Type:	Notice of Violation
Facility County:	ONONDAGA

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: NOV
Facility SIC Code: 7218
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 43.037514
Longitude in Decimal Degrees: -76.150328
Permit Type Desc: Not reported
Program System Acronym: NY0000007311500342
Facility NAICS Code: 812320
Tribal Land Code: Not reported

US AIRS MINOR:
Envid: 1000311573
Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
D and B Number: Not reported
Primary SIC Code: 7218
NAICS Code: 812320
Default Air Classification Code: MIN
Facility Type of Ownership Code: POF
Air CMS Category Code: Not reported
HPV Status: Not reported

US AIRS MINOR:
Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: Not reported
Activity Status Date: 1999-11-10 00:00:00
Activity Group: Case File
Activity Type: Case File
Activity Status: Resolved

Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 1999-03-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: MACT Standards (40 CFR Part 63)

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Activity Date: 1999-11-10 00:00:00
Activity Status Date: 1999-11-10 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Formal
Activity Status: Final Order Issued

Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 1999-04-02 00:00:00
Activity Status Date: 1999-04-02 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Informal
Activity Status: Achieved

Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2002-12-10 00:00:00
Activity Status Date: 2002-12-10 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Informal
Activity Status: Achieved

Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1984-10-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1999-12-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

FINDS:
Registry ID: 110000807431

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
All generators and treatment, storage, and disposal (TSD) facilities who handle hazardous waste are required to report to the EPA Administrator at least once every two years. The data collected is used to create the National Biennial Resource Conservation and Recovery Act (RCRA) Hazardous Waste Report. This data is processed within the RCRA Information (RCRAInfo) database
ICIS-Air (AIR) AIR is the modernization of the Air Facility System (AFS) into the Integrated Compliance Information System (ICIS). AIR contains enforcement, compliance, and permit data for stationary sources of air pollution regulated by the EPA, State, and Local air pollution agencies.
The New York Department of Environmental Conservation Facility Information System (FIS) database houses all information about facilities that are regulated or of environmental interest to the state of New York.
The Air Facility System (AFS) contains compliance and permit data for stationary sources of air pollution regulated by the EPA, state, and local air pollution agencies.
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Registry ID: 110070913211

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1000311573
Registry ID:	110000807431
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110000807431
Name:	COYNE TEXTILE SERVICES
Address:	140 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY 13202

PFAS ECHO:

Name:	RENALLI TAYLOR ST LLC
Address:	Not reported
City,State,Zip:	SYRACUSE, NY
Latitude:	43.03709
Longitude:	-76.15031
Count:	1

RENALLI TAYLOR ST LLC (Continued) **1000311573**

County:	ONONDAGA
Status:	Inactive
Region:	02
Industry:	Electronics Industry
ECHO Facility Report:	https://echo.epa.gov/detailed-facility-report?fid=110070913211
Facility Percent Minority:	46.285
Facility Derived Tribes:	Onondaga Nation - 5 mile(s), Oneida Indian Nation - 10 mile(s)
Facility Population:	5165.42
EPA Programs:	RCRA
Federal Facility:	No
Federal Agency:	-
Facility FIPS Code:	36067
Facility Indian Country Flag:	N
Facility Collection Method:	ADDRESS MATCHING-HOUSE NUMBER
Facility Derived HUC:	04140201
Facility Derived WBD:	041402011507
Facility Derived CD113:	24
Facility Derived CB2010:	360670042002018
Facility Major Flag:	-
Facility Active Flag:	-
Facility Inspection Count:	0
Facility Date Last Inspection:	-
Facility Days Last Inspection:	-
Facility Informal Count:	0
Facility Date Last Informal Action:	-
Facility Formal Action Count:	0
Facility Date Last Formal Action:	-
Facility Total Penalties:	0
Facility Penalty Count:	-
Facility Date Last Penalty:	-
Facility Last Penalty AMT:	-
Facility QTRS With NC:	0
Facility Programs With SNC:	0
Facility Compliance Status:	No Violation Identified
Facility SNC Flag:	N
AIR Flag:	N
NPDES Flag:	N
SDWIS Flag:	N
RCRA Flag:	Y
TRI Flag:	N
GHG Flag:	N
AIR IDS:	-
CAA Permit Types:	-
CAA NAICS:	-
CAA SICS:	-
NPDES IDS:	-
CWA Permit Types:	-
CWA NAICS:	-
CWA SICS:	-
RCRA IDS:	NYR000247932
RCRA Permit Types:	Other
RCRA NAICS:	334220
SDWA IDS:	-
SDWA System Types:	-
SDWA Compliance Status:	-
SDWA SNC Flag:	N
TRI IDS:	-

RENALLI TAYLOR ST LLC (Continued) **1000311573**

TRI Releases Transfers: -
TRI On Site Releases: -
TRI Off Site Transfers: -
TRI Reporter: -
Facility IMP Water Flag: -
EJSCREEN Flag US: Y

EJSCREEN Report:

DRYCLEANERS:
Name: COYNE TEXTILE SERVICES
Address: 140 CORTLAND AVE.
City,State,Zip: SYRACUSE, NY 13202
Facility ID: 7-3115-00342
Phone Number: 315-475-1626
Region: Not reported
Registration Effective Date: 12/2/1999 0:00
Inspection Date: 09/16/2012
Install Date: 99/16
Expiration Date: Not reported
Removal Date: Not reported
Drop Shop: Not reported
Shutdown: Y
Alternate Solvent: Not reported
Current Business: Not reported

RI MANIFEST:
Name: Not reported
Address: 140 CORTLAND
City,State,Zip: SYRACUSE, NY 13221-0000
EPA Id: NYD013250618
GEN Cert Date: 4/10/1997
Manifest Document Number: CTF0386557
Waste Description: FLAM LIQ
TSDF Id: CTD021816889
TSDF Name: UNITED OIL RECOVERY INC
Qty: 5250
WT/Vol Units: G
TSDF Date: Not reported
Transporter 2 Id: Not reported
Item Number: 1
Transporter 2 Name: Not reported
Transporter Name 2: UNITED IND SVS
Transporter EPAID: CTD021816889
Transporter Receipt Date: Not reported
Number Of Containers: 0
Container Type: Not reported
Waste Code1: D001
Waste Code2: Not reported
Waste Code3: Not reported
Waste Code4: Not reported
Waste Code5: Not reported
Waste Code6: Not reported
Fee Exempt Code: Not reported
Comment: Not reported
Transporter Name 2: Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Company Permit Number:	Not reported
Year:	Not reported
Quarter:	Not reported
Transporter Contact Name:	Not reported
Transporter Contact Email:	Not reported
Filing Date:	Not reported
Total Fee:	Not reported
Billing Name:	Not reported
Paid Date:	Not reported
Paid Time:	Not reported
Facility Receipt Date:	Not reported
Fee:	Not reported
Manifest Created Date:	Not reported
Manifest Updated Date:	Not reported

RI MANIFEST:

Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	D001
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	UNITED OIL RECOVERY INC
TSDF Id:	CTD021816889
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NYD013250618
Manifest Docket Number:	CTF0386557
Quarter:	Not reported
Waste Description:	FLAM LIQ
Transporter Contact Name:	Not reported
Quantity:	5250
Transporter Contact Email:	Not reported
WT/Vol Units:	G
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	UNITED IND SVS
Billing Name:	Not reported
Transporter EPA ID:	CTD021816889
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	4/10/1997
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported

Transporter Receipt Date:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	D001
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	UNITED OIL RECOVERY INC
TSDF Id:	CTD021816889
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NYD013250618
Manifest Docket Number:	CTF0386557
Quarter:	Not reported
Waste Description:	FLAM LIQ
Transporter Contact Name:	Not reported
Quantity:	5250
Transporter Contact Email:	Not reported
WT/Vol Units:	G
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	UNITED IND SVS
Billing Name:	Not reported
Transporter EPA ID:	CTD021816889
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	4/10/1997
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported

NY MANIFEST:

EPA ID:	NYR000247932
Country:	USA
Name:	RENALLI TAYLOR ST LLC
Address:	140 CORTLAND AVE
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	140 CORTLAND AVE
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Mailing:

Mailing Name:	RENALLI TAYLOR ST LLC
Mailing Contact:	RENALLI TAYLOR ST LLC
Mailing Address 1:	140 CORTLAND AVE
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2155807192

EPA ID:	NYD013250618
Country:	USA
Name:	COYNE TEXTILE SERVICES
Address:	140 CORLAND AVE
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13221
Zip 4:	Not reported
Location Address 1:	140 CORTLAND AVE
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13221
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	COYNE TEXTILE SERVICES
Mailing Contact:	ED BREWER
Mailing Address 1:	140 CORTLAND AVENUE
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13221
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154751626

Manifest Data:

Document ID:	NYC1051187
Manifest Status:	Not reported
Trans1 State ID:	NYNS7863
Year:	1991
Trans2 State ID:	Not reported
Generator Ship Date:	06/24/1991
Trans1 Recv Date:	06/24/1991
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/24/1991
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD000824581
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	01950
Units:	Pounds
Number of Containers:	010
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYC3058604
Manifest Status:	Not reported
Trans1 State ID:	NYLJ5601
Year:	1994
Trans2 State ID:	Not reported
Generator Ship Date:	06/03/1994
Trans1 Recv Date:	06/03/1994
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/06/1994
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Waste Code 1:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00585
Units:	Pounds
Number of Containers:	003
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYG2914911
Manifest Status:	Not reported
Trans1 State ID:	CT9751
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	07/27/2001
Trans1 Recv Date:	07/27/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/30/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL

RENALLI TAYLOR ST LLC (Continued) **1000311573**

BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	34700
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG2915415
Manifest Status:	Not reported
Trans1 State ID:	CTV35108
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	09/05/2001
Trans1 Recv Date:	09/05/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/06/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	42560
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYC1106223
Manifest Status:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Trans1 State ID:	NYNS7863
Year:	1991
Trans2 State ID:	Not reported
Generator Ship Date:	07/22/1991
Trans1 Recv Date:	07/22/1991
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/22/1991
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD000824581
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	02730
Units:	Pounds
Number of Containers:	014
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYG2915928
Manifest Status:	Not reported
Trans1 State ID:	V17860CT
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	08/15/2001
Trans1 Recv Date:	08/15/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/15/2001
Part A Recv Date:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	37680
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG2912184
Manifest Status:	Not reported
Trans1 State ID:	S9751CT
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	04/05/2001
Trans1 Recv Date:	04/05/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/05/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	43160
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG2912445
Manifest Status:	Not reported
Trans1 State ID:	CTV35108
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	04/19/2001
Trans1 Recv Date:	04/19/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/19/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	42640
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG2913138

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Manifest Status:	Not reported
Trans1 State ID:	V17860CT
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	05/14/2001
Trans1 Recv Date:	05/14/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/14/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	37500
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG2913381
Manifest Status:	Not reported
Trans1 State ID:	S9751CT
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	05/29/2001
Trans1 Recv Date:	05/29/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/29/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	38120
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG2914191
Manifest Status:	Not reported
Trans1 State ID:	CTV35108
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	06/25/2001
Trans1 Recv Date:	06/25/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/26/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	CTD021816889
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Waste Code 6:	Not reported
Quantity:	05000
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Click this hyperlink while viewing on your computer to access
1075 additional NY MANIFEST: record(s) in the EDR Site Report.

X109 **FORMER COYNE TEXTILE** **NY ENG CONTROLS** **S120706175**
SW **140 CORTLAND AVENUE** **NY INST CONTROL** **N/A**
1/4-1/2 **SYRACUSE, NY 13202** **NY BROWNFIELDS**
0.279 mi.
1473 ft. **Site 2 of 2 in cluster X**

Relative:
Lower

Actual:
390 ft.

ENG CONTROLS:

Name:	FORMER COYNE TEXTILE
Address:	140 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY 13202
Site Code:	507968
HW Code:	C734144
Control Code:	13
Control Type:	ENG
Date Record Added:	11/05/2021
Date Rec Updated:	12/28/2021
Updated By:	MJBELVEG
Site Description:	"Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus

FORMER COYNE TEXTILE (Continued) **S120706175**

storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem:	"Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "
Health Problem:	"Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	True
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2017-05-18 08:36:00
Record Upd:	2021-05-25 15:20:00
Updated By:	MJBELVEG
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	1
Sub Type:	E

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	po box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	B99
Owner Name:	Web Application
Owner Company:	DECInfo Locator
Owner Address:	https://www.dec.ny.gov/data/DecDocs/C734144/
Owner Addr2:	Not reported
Owner City,St,Zip:	NY
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties Holdings LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	1
Sub Type:	P03
Owner Name:	Dino Peios
Owner Company:	JMA Tech properties, LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	Liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA TECH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Company:	XRN LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA EDGE SERVICES, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	PREVAIL NY LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	CELLH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
HW Code:	C734144
Waste Type:	1,1 dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	cis-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trichloroethene (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	vinyl chloride
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	iron
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trans-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported

FORMER COYNE TEXTILE (Continued) **S120706175**

HW Code:	C734144
Waste Type:	beryllium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	manganese
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	sodium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	magnesium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	bis(2-ethylhexyl)phthalate
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	benzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	copper
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	chromium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	isopropylbenzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	thallium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	xylene (mixed)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	barium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	1412187
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:56:00
Record Updated:	2015-05-20 10:56:00

FORMER COYNE TEXTILE (Continued) **S120706175**

Updated By:	SMFITZGE
Crossref ID:	1408779
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:58:00
Record Updated:	2015-05-20 10:58:00
Updated By:	SMFITZGE
Crossref ID:	C734144-05-17
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2021-09-09 10:05:00
Record Updated:	2021-09-09 10:05:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048750
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048743
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	C734144A
Cross Ref Type Code:	22
Cross Ref Type:	BCP Site ID
Record Added Date:	2019-01-02 13:56:00
Record Updated:	2019-01-02 13:56:00
Updated By:	MJBELVEG
Crossref ID:	C734144-06-15
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2020-02-10 08:30:00
Record Updated:	2020-02-10 08:30:00
Updated By:	MJBELVEG
Crossref ID:	2005960
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2020-10-28 13:03:00
Record Updated:	2020-10-28 13:03:00
Updated By:	MJBELVEG

Name:	FORMER COYNE TEXTILE
Address:	140 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY 13202
Site Code:	507968
HW Code:	C734144
Control Code:	15
Control Type:	ENG
Date Record Added:	11/05/2021
Date Rec Updated:	12/28/2021
Updated By:	MJBELVEG
Site Description:	"Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140

FORMER COYNE TEXTILE (Continued) **S120706175**

Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives

FORMER COYNE TEXTILE (Continued) **S120706175**

	for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "
Health Problem:	"Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	True
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2017-05-18 08:36:00
Record Upd:	2021-05-25 15:20:00
Updated By:	MJBELVEG
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	1
Sub Type:	E
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	po box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	B99
Owner Name:	Web Application
Owner Company:	DECInfo Locator
Owner Address:	https://www.dec.ny.gov/data/DecDocs/C734144/
Owner Addr2:	Not reported
Owner City,St,Zip:	NY
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties Holdings LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	1

FORMER COYNE TEXTILE (Continued) **S120706175**

Sub Type:	P03
Owner Name:	Dino Peios
Owner Company:	JMA Tech properties, LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	Liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA TECH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	XRN LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA EDGE SERVICES, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	PREVAIL NY LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	CELLH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
HW Code:	C734144
Waste Type:	1,1 dichloroethene

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	cis-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trichloroethene (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	vinyl chloride
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	iron
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trans-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	beryllium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	manganese
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	sodium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	magnesium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	bis(2-ethylhexyl)phthalate
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	benzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	copper
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	chromium
Waste Quantity:	UNKNOWN

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Code:	Not reported
HW Code:	C734144
Waste Type:	isopropylbenzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	thallium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	xylene (mixed)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	barium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	1412187
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:56:00
Record Updated:	2015-05-20 10:56:00
Updated By:	SMFITZGE
Crossref ID:	1408779
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:58:00
Record Updated:	2015-05-20 10:58:00
Updated By:	SMFITZGE
Crossref ID:	C734144-05-17
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2021-09-09 10:05:00
Record Updated:	2021-09-09 10:05:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048750
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048743
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	C734144A
Cross Ref Type Code:	22
Cross Ref Type:	BCP Site ID
Record Added Date:	2019-01-02 13:56:00
Record Updated:	2019-01-02 13:56:00
Updated By:	MJBELVEG

FORMER COYNE TEXTILE (Continued) **S120706175**

Crossref ID:	C734144-06-15
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2020-02-10 08:30:00
Record Updated:	2020-02-10 08:30:00
Updated By:	MJBELVEG
Crossref ID:	2005960
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2020-10-28 13:03:00
Record Updated:	2020-10-28 13:03:00
Updated By:	MJBELVEG
Name:	FORMER COYNE TEXTILE
Address:	140 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY 13202
Site Code:	507968
HW Code:	C734144
Control Code:	36
Control Type:	ENG
Date Record Added:	11/05/2021
Date Rec Updated:	12/28/2021
Updated By:	MJBELVEG
Site Description:	"Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup

FORMER COYNE TEXTILE (Continued) **S120706175**

	Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."
Env Problem:	"Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "
Health Problem:	"Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	True
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2017-05-18 08:36:00
Record Upd:	2021-05-25 15:20:00
Updated By:	MJBELVEG
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	1
Sub Type:	E
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	po box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	B99
Owner Name:	Web Application
Owner Company:	DECInfo Locator
Owner Address:	https://www.dec.ny.gov/data/DecDocs/C734144/
Owner Addr2:	Not reported
Owner City,St,Zip:	NY
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties Holdings LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	1
Sub Type:	P03
Owner Name:	Dino Peios
Owner Company:	JMA Tech properties, LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	Liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA TECH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	XRN LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America

FORMER COYNE TEXTILE (Continued) **S120706175**

Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA EDGE SERVICES, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	PREVAIL NY LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	CELLH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
HW Code:	C734144
Waste Type:	1,1 dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	cis-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trichloroethene (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	vinyl chloride
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	iron
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trans-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	beryllium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Type:	manganese
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	sodium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	magnesium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	bis(2-ethylhexyl)phthalate
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	benzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	copper
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	chromium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	isopropylbenzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	thallium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	xylene (mixed)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	barium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	1412187
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:56:00
Record Updated:	2015-05-20 10:56:00
Updated By:	SMFITZGE
Crossref ID:	1408779
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:58:00

FORMER COYNE TEXTILE (Continued) **S120706175**

Record Updated: 2015-05-20 10:58:00
Updated By: SMFITZGE
Crossref ID: C734144-05-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG

INST CONTROL:
Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: Landuse Restriction
HW Code: C734144
Control Code: 25
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022

FORMER COYNE TEXTILE (Continued) **S120706175**

South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

FORMER COYNE TEXTILE (Continued) **S120706175**

Health Problem:	"Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	True
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2017-05-18 08:36:00
Record Upd:	2021-05-25 15:20:00
Updated By:	MJBELVEG
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	1
Sub Type:	E
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	po box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	B99
Owner Name:	Web Application
Owner Company:	DECInfo Locator
Owner Address:	https://www.dec.ny.gov/data/DecDocs/C734144/
Owner Addr2:	Not reported
Owner City,St,Zip:	NY
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties Holdings LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	1
Sub Type:	P03
Owner Name:	Dino Peios

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported

FORMER COYNE TEXTILE (Continued) **S120706175**

HW Code:	C734144
Waste Type:	cis-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trichloroethene (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	vinyl chloride
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	iron
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trans-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	beryllium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	manganese
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	sodium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	magnesium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	bis(2-ethylhexyl)phthalate
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	benzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	copper
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	chromium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Type: isopropylbenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00
Record Updated: 2015-05-20 10:58:00
Updated By: SMFITZGE
Crossref ID: C734144-05-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG
Crossref ID: C734144-06-15
Cross Ref Type Code: 23

FORMER COYNE TEXTILE (Continued) **S120706175**

Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG

Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: Environmental Easement
HW Code: C734144
Control Code: J
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup

FORMER COYNE TEXTILE (Continued) **S120706175**

Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

Dump: False
Structure: False
Lagoon: False
Landfill: True
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-05-18 08:36:00
Record Upd: 2021-05-25 15:20:00
Updated By: MJBELVEG
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: po box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator
Owner Address: https://www.dec.ny.gov/data/DecDocs/C734144/
Owner Addr2: Not reported
Owner City,St,Zip: NY
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America

FORMER COYNE TEXTILE (Continued) **S120706175**

Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: cis-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trichloroethene (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: vinyl chloride
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: iron
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trans-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: beryllium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Type: manganese
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: sodium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: magnesium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: benzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: copper
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: chromium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: isopropylbenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00

FORMER COYNE TEXTILE (Continued) **S120706175**

Record Updated: 2015-05-20 10:58:00
Updated By: SMFITZGE
Crossref ID: C734144-05-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG

Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: O&M Plan
HW Code: C734144
Control Code: 33
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina

FORMER COYNE TEXTILE (Continued) **S120706175**

Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent

FORMER COYNE TEXTILE (Continued) **S120706175**

people from coming into contact with remaining contamination."
Dump: False
Structure: False
Lagoon: False
Landfill: True
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-05-18 08:36:00
Record Upd: 2021-05-25 15:20:00
Updated By: MJBELVEG
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: po box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator
Owner Address: https://www.dec.ny.gov/data/DecDocs/C734144/
Owner Addr2: Not reported
Owner City,St,Zip: NY
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Type: cis-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trichloroethene (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: vinyl chloride
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: iron
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trans-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: beryllium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: manganese
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: sodium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: magnesium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: benzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: copper
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: chromium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: isopropylbenzene

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00
Record Updated: 2015-05-20 10:58:00
Updated By: SMFITZGE
Crossref ID: C734144-05-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number

FORMER COYNE TEXTILE (Continued) **S120706175**

Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG

Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: Monitoring Plan
HW Code: C734144
Control Code: 31
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The

FORMER COYNE TEXTILE (Continued) **S120706175**

site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

Dump: False
Structure: False
Lagoon: False
Landfill: True
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-05-18 08:36:00
Record Upd: 2021-05-25 15:20:00
Updated By: MJBELVEG
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: po box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America

FORMER COYNE TEXTILE (Continued) **S120706175**

Own Op: Document Repository
Sub Type: NNN
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator
Owner Address: https://www.dec.ny.gov/data/DecDocs/C734144/
Owner Addr2: Not reported
Owner City,St,Zip: NY
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6

FORMER COYNE TEXTILE (Continued) **S120706175**

Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: cis-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trichloroethene (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: vinyl chloride
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: iron
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trans-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: beryllium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: manganese

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: sodium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: magnesium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: benzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: copper
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: chromium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: isopropylbenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00
Record Updated: 2015-05-20 10:58:00

FORMER COYNE TEXTILE (Continued) **S120706175**

Updated By: SMFITZGE
Crossref ID: C734144-05-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG

Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: Site Management Plan
HW Code: C734144
Control Code: 32
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling

FORMER COYNE TEXTILE (Continued) **S120706175**

approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

FORMER COYNE TEXTILE (Continued) **S120706175**

Dump: False
Structure: False
Lagoon: False
Landfill: True
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-05-18 08:36:00
Record Upd: 2021-05-25 15:20:00
Updated By: MJBELVEG
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: po box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator
Owner Address: https://www.dec.ny.gov/data/DecDocs/C734144/
Owner Addr2: Not reported
Owner City,St,Zip: NY
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: cis-1,2-dichloroethene

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trichloroethene (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: vinyl chloride
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: iron
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trans-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: beryllium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: manganese
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: sodium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: magnesium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: benzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: copper
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: chromium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: isopropylbenzene
Waste Quantity: UNKNOWN

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Code: Not reported
HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00
Record Updated: 2015-05-20 10:58:00
Updated By: SMFITZGE
Crossref ID: C734144-05-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00

FORMER COYNE TEXTILE (Continued) **S120706175**

Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG

Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: IC/EC Plan
HW Code: C734144
Control Code: 34
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level

FORMER COYNE TEXTILE (Continued) **S120706175**

and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

Dump: False
Structure: False
Lagoon: False
Landfill: True
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-05-18 08:36:00
Record Upd: 2021-05-25 15:20:00
Updated By: MJBELVEG
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: po box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository

FORMER COYNE TEXTILE (Continued) **S120706175**

Sub Type: NNN
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator
Owner Address: https://www.dec.ny.gov/data/DecDocs/C734144/
Owner Addr2: Not reported
Owner City,St,Zip: NY
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: cis-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trichloroethene (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: vinyl chloride
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: iron
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trans-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: beryllium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: manganese
Waste Quantity: UNKNOWN

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Code: Not reported
HW Code: C734144
Waste Type: sodium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: magnesium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: benzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: copper
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: chromium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: isopropylbenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00
Record Updated: 2015-05-20 10:58:00
Updated By: SMFITZGE

FORMER COYNE TEXTILE (Continued) **S120706175**

Crossref ID: C734144-05-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG

Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: Ground Water Use Restriction
HW Code: C734144
Control Code: 08
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by

FORMER COYNE TEXTILE (Continued) **S120706175**

commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

Dump: False

FORMER COYNE TEXTILE (Continued) **S120706175**

Structure: False
Lagoon: False
Landfill: True
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-05-18 08:36:00
Record Upd: 2021-05-25 15:20:00
Updated By: MJBELVEG
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: po box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator
Owner Address: https://www.dec.ny.gov/data/DecDocs/C734144/
Owner Addr2: Not reported
Owner City,St,Zip: NY
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678
Owner Addr2: Not reported

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: cis-1,2-dichloroethene
Waste Quantity: UNKNOWN

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Code: Not reported
HW Code: C734144
Waste Type: trichloroethene (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: vinyl chloride
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: iron
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trans-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: beryllium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: manganese
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: sodium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: magnesium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: benzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: copper
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: chromium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: isopropylbenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported

FORMER COYNE TEXTILE (Continued) **S120706175**

HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00
Record Updated: 2015-05-20 10:58:00
Updated By: SMFITZGE
Crossref ID: C734144-05-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00

FORMER COYNE TEXTILE (Continued) **S120706175**

Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG

BROWNFIELDS:

Name:	FORMER COYNE TEXTILE
Address:	140 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	507968
Acres:	3.255
HW Code:	C734144
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	05/15/2015
Record Updated Date:	01/08/2024
Update By:	GWPRISCO
Site Description:	"Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level

FORMER COYNE TEXTILE (Continued) **S120706175**

	and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."
Env Problem:	"Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "
Health Problem:	"Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	True
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2017-05-18 08:36:00
Record Upd:	2021-05-25 15:20:00
Updated By:	MJBELVEG
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	1
Sub Type:	E
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	po box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	Document Repository

FORMER COYNE TEXTILE (Continued) **S120706175**

Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	B99
Owner Name:	Web Application
Owner Company:	DECInfo Locator
Owner Address:	https://www.dec.ny.gov/data/DecDocs/C734144/
Owner Addr2:	Not reported
Owner City,St,Zip:	NY
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties Holdings LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	1
Sub Type:	P03
Owner Name:	Dino Peios
Owner Company:	JMA Tech properties, LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	Liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA TECH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	XRN LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Name:	Dino peios
Owner Company:	JMA EDGE SERVICES, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	PREVAIL NY LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	CELLH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
HW Code:	C734144
Waste Type:	1,1 dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	cis-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trichloroethene (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	vinyl chloride
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	iron
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trans-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	beryllium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	manganese
Waste Quantity:	UNKNOWN

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Code:	Not reported
HW Code:	C734144
Waste Type:	sodium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	magnesium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	bis(2-ethylhexyl)phthalate
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	benzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	copper
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	chromium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	isopropylbenzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	thallium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	xylene (mixed)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	barium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	1412187
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:56:00
Record Updated:	2015-05-20 10:56:00
Updated By:	SMFITZGE
Crossref ID:	1408779
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:58:00
Record Updated:	2015-05-20 10:58:00
Updated By:	SMFITZGE

FORMER COYNE TEXTILE (Continued) **S120706175**

Crossref ID:	C734144-05-17
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2021-09-09 10:05:00
Record Updated:	2021-09-09 10:05:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048750
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048743
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	C734144A
Cross Ref Type Code:	22
Cross Ref Type:	BCP Site ID
Record Added Date:	2019-01-02 13:56:00
Record Updated:	2019-01-02 13:56:00
Updated By:	MJBELVEG
Crossref ID:	C734144-06-15
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2020-02-10 08:30:00
Record Updated:	2020-02-10 08:30:00
Updated By:	MJBELVEG
Crossref ID:	2005960
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2020-10-28 13:03:00
Record Updated:	2020-10-28 13:03:00
Updated By:	MJBELVEG

Y110 **1073-1079 SOUTH SALINA STREET** **US BROWNFIELDS** **1016352218**
SSW **1073-1079 SOUTH SALINA STREET** **FINDS** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.280 mi.
1478 ft. **Site 1 of 4 in cluster Y**

Relative: **Lower**
Actual: **390 ft.**

US BROWNFIELDS:

Name:	1073-1079 SOUTH SALINA STREET
Address:	1073-1079 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	14744
Property Alias:	Not reported
Recipient Name:	Syracuse, City of
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	Not reported
Latitude:	43.036912
Longitude:	-76.149464
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BP

1073-1079 SOUTH SALINA STREET (Continued) **1016352218**

AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98229401
Start Date:	12/31/2002
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	12/31/2002
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Not reported
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	U
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported

1073-1079 SOUTH SALINA STREET (Continued) **1016352218**

RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2598
Below Poverty Percent:	54.51
Meidan Income:	1562
Meidan Income Number:	3674
Meidan Income Percent:	77.09
Vacant Housing Number:	285
Vacant Housing Percent:	14.75
Unemployed Number:	374
Unemployed Percent:	7.85

FINDS:
Registry ID: 110039547005

Click Here for FRS Facility Detail Report:

1073-1079 SOUTH SALINA STREET (Continued) **1016352218**

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

Y111 **1081-1085 SOUTH SALINA STREET** **US BROWNFIELDS** **1016352220**
SSW **1081-1085 SOUTH SALINA STREET** **FINDS** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.285 mi.
1507 ft. **Site 2 of 4 in cluster Y**

Relative: **Lower**
Actual: **390 ft.**

US BROWNFIELDS:

Name:	1081-1085 SOUTH SALINA STREET
Address:	1081-1085 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	14745
Property Alias:	Not reported
Recipient Name:	Syracuse, City of
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	Not reported
Latitude:	43.036813
Longitude:	-76.14945
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BP
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98229401
Start Date:	9/30/2002
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	9/30/2002
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Not reported
Indicates Cleanup/Treatment Tech Implemented:	Not reported

1081-1085 SOUTH SALINA STREET (Continued) **1016352220**

Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	U
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported

1081-1085 SOUTH SALINA STREET (Continued) **1016352220**

NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2632
Below Poverty Percent:	53.85
Meidan Income:	1562
Meidan Income Number:	3718
Meidan Income Percent:	76.06
Vacant Housing Number:	288
Vacant Housing Percent:	14.62
Unemployed Number:	378
Unemployed Percent:	7.73

FINDS:
Registry ID: 110039547032

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

Y112 **SOUTH SALINA STREET PARCELS** **NY BROWNFIELDS S122449240**
SSW **1081 SOUTH SALINA STREET** **NY Spills N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.285 mi.
1507 ft. **Site 3 of 4 in cluster Y**

Relative:
Lower

Actual:
390 ft.

BROWNFIELDS:

Name:	SOUTH SALINA STREET PARCELS
Address:	1081 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	570636
Acres:	1.892
HW Code:	C734140
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	05/22/2018
Record Updated Date:	06/17/2024
Update By:	GWPRISCO

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

Site Description: "Location: The site is 1.89 acres and is bordered on the west by South Salina Street, across the street from the former Coyne Textile Services Brownfield Cleanup Program site (ref. Site No. C734144); on the south by a church; to the north by a small glass and mirror shop; and to the east by a community center along Montgomery Street. Site Features: Currently, the site is undeveloped with no structures on the property. The site is a relatively flat lot with broken pavement along with grassed-vegetated areas and some mature trees across the property. Current Zoning and Land Use: The site property is zoned as BA District, which permits the intensive development of land for mixed residential, retail, service and certain industrial uses. Adjacent parcels are zoned for commercial (CA) to the north, west, and southwest, BA to the north and south, and residential (RB) to the east. Other nearby parcels are a mix of industrial, commercial, business, and residential land uses. Past Use of the Site: Previously, the site was used as an above-ground storage tank facility for manufactured gas generated from coal or oil. The approximately 125-foot diameter tank, called a gasometer, stored gas for distribution for city and private lighting, cooking, and heating. The facility operated in the late 1890s until taken out of service sometime before 1951. Thereafter, various uses of the site included a rug cleaner, bottling operation, laundry/dry cleaner, automobile repair, refrigerator repair shop, tailor, plumbing shop, paint shop, and a glass warehouse. The buildings were demolished in the late 1970s and early 1980s and then the site was used as a parking lot. Site Geology and Hydrogeology: The greater portion of the site is underlain with a mix of sand, silt, and clay soils that contain historic fill to a depth of approximately 20 feet. The historic fill contains clay tile, ash, coal and brick. Native soil is located below the fill and consists of peat and marl. The depth to water is approximately 7 to 10 feet below grade with groundwater flow direction to the north-west "

Env Problem: "A remedial investigation was conducted to assess the nature and extent of contamination at the site. The remedial investigation consisted of the following elements: the evaluation of buried utilities; collection and analysis of eight surface soil samples; the installation of 33 soil borings which included the collection and analysis of 18 subsurface soil samples; the excavation of six test pits with the analysis of one soil sample; and the installation of five groundwater monitoring wells which included two rounds of groundwater monitoring. Soil and groundwater samples were analyzed for a combination of volatile organic compounds (VOCs), semi-volatile organic compounds (SVOCs), pesticides, herbicides, PCBs, metals (including mercury, cyanide, and hexavalent chromium), 1,4-dioxane, and PFOS/PFOA. Soils: Contaminants of concern have been identified at concentrations that exceed the Restricted-Residential (RR) Soil Cleanup Objectives (SCOs). The contamination of the soils is generally associated within the historical fill material (HFM) at the site. HFM was observed at varying depths from the surface to approximately 20 feet below grade. SVOCs are present in surface soil samples across the site at concentrations that exceed Restricted-Residential Use SCOs. SVOCs and metals are also present in the sub-surface soils within the HFM at concentrations above Restricted Residential Use SCOs. The types and concentrations of SVOCs and metals that have been identified are consistent with those typically found in historically industrialized urban areas. Native soils sampled from beneath the HFM do not exceed RR SCOs for any

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

analytes. These results suggest that the contaminants of concern are contained within the observed on-site HFM. Surface Soil: Sampling depth: 0 to 2 inches A total of eight surface samples were obtained across the site. Laboratory results indicate several SVOCs are above Restricted Residential (RR) use SCOs including, benzo(a)anthracene with concentrations ranging from 1.7 to 5.5 parts per million (ppm) compared to the RR Use SCO value of 1 ppm; benzo(a)pyrene with concentrations ranging from 1.6 to 4.8 ppm compared to the RR Use SCO value of 1 ppm; benzo(b)fluoranthene with concentrations ranging from 2.3 to 6.6 ppm compared to the RR Use SCO value of 1 ppm; chrysene with concentrations ranging 1.7 to 5.2 ppm compared to the RR Use SCO value of 3.9 ppm; dibenzo(a,h)anthracene with concentrations ranging from 0.37 to 0.7 ppm compared to the RR Use SCO value of 0.33 ppm, and indeno (1,2,3-cd)pyrene with concentrations ranging from 1.1 to 2.8 ppm compared to the RR Use SCO value of 0.5 ppm. Sub-Surface Soils: A total of 18 subsurface samples were collected from across the site. Laboratory results of the soils samples obtained from areas containing HFM indicate SVOCs are present at concentrations above Protection of Groundwater SCOs and Restricted-Residential Use SCOs and, to a lesser degree, metals are present at concentrations above Residential-Restricted Use SCOs Laboratory results indicate several SVOCs are above Restricted Residential Use SCOs including, benzo(a)anthracene with concentrations ranging from 1.6 to 51 parts per million (ppm) compared to the RR Use SCO value of 1 ppm; benzo(a)pyrene with concentrations ranging from 1.2 to 39 ppm compared to the RR Use SCO value of 1 ppm; benzo(b)fluoranthene with concentrations ranging from 1.6 to 49 ppm compared to the RR Use SCO value of 1 ppm; benzo(k)fluoranthene with concentrations ranging from 8.2 to 18 ppm compared to the RR Use SCO value of 3.9 ppm; chrysene with concentrations ranging 3.9 to 40 ppm compared to the RR Use SCO value of 3.9 ppm; dibenzo(a,h)anthracene with concentrations ranging from 0.38 to 5.3 ppm compared to the RR Use SCO value of 0.33 ppm; indeno(1,2,3-cd) pyrene with concentrations ranging from 0.72 to 24 ppm compared to the RR Use SCO value of 0.5 ppm, and phenanthrene with a concentration of 100 ppm compared to the RR Use SCO value of 100 ppm. Laboratory results indicate several metals above Restricted Residential Use SCOs including, total copper with a concentration of 495 ppm compared to the RR Use SCO value of 270 ppm; lead with a concentration of 415 ppm compared to the RR Use SCO value of 400 ppm; and total mercury with concentrations ranging from 0.88 to 1.2 ppm compared to the RR Use SCO value of 0.81 ppm. Five test pits were advanced at areas identified as anomalies during a previous geophysical study. At each location, the subsurface contained construction and demolition (C&D) debris, including wood, concrete, brick, asphalt, as well as HFM. Similar observations of fill were made in borings advanced within a large anomaly that coincided with the footprint of the former gasometer. No tanks, vaults, or other subsurface structures were identified while excavating the test pits. In addition, no visual evidence of contamination (e.g., stains or odors) was observed. Due to the presence of ash at test pit TP-4, a sample was collected. Laboratory results indicate no analytes were above Restricted-Residential Use SCOs. Groundwater: Groundwater samples were collected twice, once in October 2019 and again in January 2020, from five groundwater monitoring wells across the site. The depth to groundwater is approximately seven to ten feet below grade with a groundwater flow direction to the northwest. The results of the laboratory analysis

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

indicate the principal groundwater contaminants are volatile organic compounds (VOCs). A number of VOCs were observed above the NYSDEC Technical and Operational Guidance Series (TOGS) groundwater protection standards. The groundwater contamination is primarily located in the central portion of the site in monitoring wells MW-1 and MW-2. Benzene is present at monitoring wells MW-1 and MW-2 with a concentration range from 58 to 190 ppb, compared to the TOGS standard of 1 ppb. Toluene is present in MW-2 with a concentration range from 11 to 40 ppb, compared to the TOGS standard of 5 ppb. Ethylbenzene is present in MW-2 with a concentration range from ND to 19 ppb, compared to the TOGS standard of 5 ppb. P/M xylene is present in MW-2 with a concentration range from ND to 20 ppb, compared to the TOGS standard of 5 ppb. O-xylene is present in MW-2 with a concentration range from ND to 12 ppb, compared to the TOGS standard of 5 ppb. Styrene is present in MW-2 with a concentration range from ND to 8.8 ppb, compared to the TOGS standard of 5 ppb. No other VOCs exceeded NYSDEC TOGS values at the site. There are several semi-volatile organic compounds (SVOCs) that are slightly above NYSDEC TOGS groundwater protection values, with no single compound concentration greater than 0.12 parts per billion (ppb). Laboratory results identified the following compounds above the NYSDEC TOGS value of 0.002 ppb: benzo(a) anthracene ranging from 0.02 to 0.12 ppb; benzo(a)pyrene ranging from 0.02 to 0.09 ppb; benzo(b)fluoranthene ranging from 0.01 to 0.11 ppb; benzo (k)fluoranthene ranging from 0.01 to 0.05 ppb; chrysene ranging from 0.01 to 0.07 ppb; and indeno (1,2,3-cd) pyrene ranging from 0.02 to 0.07 ppb. Laboratory analysis of the groundwater for pesticides, herbicides and PCBs are non-detect at concentrations greater than the laboratory detection limits. Laboratory analysis of the groundwater for PFOA and PFOS indicate concentrations that are below NYS DEC/DOH threshold values. Laboratory analysis results for 1,4 dioxane are non-detect. Metals commonly associated with hard water (e.g., iron, magnesium, manganese, sodium) are present at concentrations above the TOGs values in each well. These metals are likely naturally occurring and in this setting are unrelated to the site's past activities. However, in monitoring well MW-1 barium slightly exceeds the TOGS value of 1,000 ppb, with a concentration value of 1,002 ppb. In addition, the general region of central New York has been known for elevated saline (sodium) concentrations in the groundwater. Laboratory analysis of the groundwater from this site supports this with dissolved sodium concentrations range from 35,200 up to 181,000 parts per billion in comparison to the TOGS value of 20,000 parts per billion. Off-site impacts in soil and groundwater are expected to be minimal based on the level and pattern of on-site contamination. SVOCs are present in surface soil and sub-surface soil across the site at concentrations that exceed Restricted-Residential Use SCOs and Protection of Groundwater SCOs. However, the types and concentrations of SVOCs and metals that have been identified in the soil are typically found at historically industrialized urban areas as in this instance. There are moderate levels of VOCs in site groundwater that are primarily located within the central portion of the site. Concentrations of SVOCs in site groundwater are slightly above groundwater protection values, but SVOCs do not readily migrate. Given the moderate concentrations of the contaminants of concern in the soil and groundwater it is anticipated the contaminants concentrations will decrease over time due to adsorption and natural attenuation. As a result, it is expected that off-site impacts from on-site

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

	contamination to neighboring properties is minimal. "
Health Problem:	"People who enter the site may come into contact with site related soil and groundwater contamination if they dig below the surface. Contaminated groundwater at the site is not used for drinking or other purposes and the site is served by a public water supply that obtains water from a different source not affected by this contamination. Volatile organic compounds in soil vapor (air spaces within the soil) may move into buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. The site is vacant so inhalation of site contaminants in indoor air via the soil vapor intrusion pathway is not a current concern. However, the potential exists for inhalation of site contaminants due to soil vapor intrusion for any future onsite development. Environmental sampling indicates that soil vapor intrusion associated with contamination at the site is not a concern for offsite buildings."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2019-01-07 10:39:00
Record Upd:	2020-02-21 11:10:00
Updated By:	CFMANNES
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Honora Spillane
Owner Company:	Syracuse Industrial Development Agency
Owner Address:	City Commons Hall, 201 E. Washington St, 7th Fl.
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	P03
Owner Name:	Gail Montplaisir
Owner Company:	Salina 1st, LLC
Owner Address:	321 West Taylor Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Gail montplaisir
Owner Company:	Salina 1st, LLC
Owner Address:	1341 H Street, Suite 301
Owner Addr2:	Not reported
Owner City,St,Zip:	Wasington, DC 20002
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Christopher F. Mannes, P.E.
Owner Company:	NYS DEC - Region 7 Office

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

Owner Address:	615 Erie Blvd. West
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13204
Owner Country:	United States of America
HW Code:	C734140
Waste Type:	barium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	benzo(a)anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	indeno(1,2,3-CD)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	xylene (mixed)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	benzo(k)fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	ethylbenzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	styrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	dibenz[a,h]anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	toluene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	benzo(b)fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	mercury
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

Waste Type:	copper
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	benzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	benzo(a)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	734140
Cross Ref Type Code:	02
Cross Ref Type:	HW Site ID
Record Added Date:	2022-10-17 15:11:00
Record Updated:	2022-10-17 15:11:00
Updated By:	CFMANNES
Crossref ID:	734120
Cross Ref Type Code:	02
Cross Ref Type:	HW Site ID
Record Added Date:	2022-10-17 15:18:00
Record Updated:	2022-10-17 15:18:00
Updated By:	CFMANNES
Crossref ID:	2022-00051127
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2023-10-13 15:52:00
Record Updated:	2023-10-13 15:52:00
Updated By:	ACLOFARO

SPILLS:

Name:	CONTRUCTION SITE
Address:	1081 SOUTH SALINA ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2204171 / 2022-08-18
Facility ID:	2204171
Facility Type:	ER
DER Facility ID:	586819
Site ID:	640303
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2022-08-11
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2022-08-11
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

Date Entered In Computer:	2022-08-11
Spill Record Last Update:	2022-08-18
Spiller Name:	BERTI
Spiller Company:	PARAGON ENVIRONMENTAL CONTRUCTION
Spiller Address:	1081 SOUTH SALINA ST
Spiller Company:	999
Contact Name:	BERTI
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	handled by chris mannes
Remarks:	Clean up completed.

All Materials:

Site ID:	640303
Operable Unit ID:	1387352
Operable Unit:	01
Material ID:	2402272
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

113
WSW
1/4-1/2
0.292 mi.
1541 ft.

S&F AUTOMOTIVE **NY LTANKS** **S100494064**
420 ONEIDA ST **N/A**
SYRACUSE, NY

Relative:
Lower

Actual:
390 ft.

LTANKS:

Name:	S&F AUTOMOTIVE
Address:	420 ONEIDA ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9207347 / 1992-10-05
Facility ID:	9207347
Site ID:	194355
Spill Date:	1992-09-24
Spill Cause:	Tank Failure
Spill Source:	Commercial Vehicle
Spill Class:	D5
Cleanup Ceased:	1992-10-05
SWIS:	3415
Investigator:	MENASH
Referred To:	Not reported
Reported to Dept:	1992-09-24
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Affected Persons
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0

S&F AUTOMOTIVE (Continued) **S100494064**

Date Entered In Computer:	1992-09-25
Spill Record Last Update:	1992-10-05
Spiller Name:	Not reported
Spiller Company:	S & F AUTOMOTIVE
Spiller Address:	420 ONEIDA ST
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	161962
Latitude:	43.0398573
Longitude:	-76.1530760
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MN 10/05/92: NO RESPONSE MADE.
Remarks:	VEHICLE LEAKED ONTO PAVEMENT AND OIL SWEEPED INTO STORM SEWER BY S&F PERSONNEL.

All Materials:

Site ID:	194355
Operable Unit ID:	974302
Operable Unit:	01
Material ID:	407985
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	50.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Z114 **MONTGOMERY STREET** **NY LTANKS** **S106719238**
NNW **MONGOMERY ST AND MADISON** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.293 mi.
1547 ft. **Site 1 of 2 in cluster Z**

Relative: **Lower**
Actual: **394 ft.**

LTANKS:

Name:	MONTGOMERY STREET
Address:	MONGOMERY ST AND MADISON
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0310457 / 2003-12-15
Facility ID:	0310457
Site ID:	316015
Spill Date:	2003-12-10
Spill Cause:	Tank Failure
Spill Source:	Unknown
Spill Class:	D4
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	2003-12-10
CID:	404
Water Affected:	Not reported

MONTGOMERY STREET (Continued) **S106719238**

Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2003-12-10
Spill Record Last Update:	2003-12-15
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	BARB WHITE
Spiller Phone:	(315) 435-8884
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	254763
Latitude:	43.0454779
Longitude:	-76.1488159
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was HW
Remarks:	no response required. just need a spill number. a leak in a gas tank caused the spill.

All Materials:

Site ID:	316015
Operable Unit ID:	875549
Operable Unit:	01
Material ID:	499312
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Y115 **1101-1111 SOUTH SALINA STREET** **US BROWNFIELDS** **1016352224**
SSW **1101-1111 SOUTH SALINA STREET** **FINDS** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.293 mi.
1547 ft. **Site 4 of 4 in cluster Y**

Relative: **Lower**
Actual: **390 ft.**

US BROWNFIELDS:

Name:	1101-1111 SOUTH SALINA STREET
Address:	1101-1111 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	14746
Property Alias:	Not reported
Recipient Name:	Syracuse, City of
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	Not reported
Latitude:	43.036312
Longitude:	-76.149452
Census Tract:	36067004200

1101-1111 SOUTH SALINA STREET (Continued) **1016352224**

State or Tribal Voluntary Response Program:	Not reported
Program Name:	BP
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98229401
Start Date:	9/30/2002
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	9/30/2002
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Not reported
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	U
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported

1101-1111 SOUTH SALINA STREET (Continued) **1016352224**

Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2555
Below Poverty Percent:	53.61
Meidan Income:	1562
Meidan Income Number:	3612
Meidan Income Percent:	75.79
Vacant Housing Number:	283
Vacant Housing Percent:	14.86
Unemployed Number:	354
Unemployed Percent:	7.43

FINDS:
Registry ID: 110039547078

1101-1111 SOUTH SALINA STREET (Continued) **1016352224**

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

AA116 **CHIMES BUILDING** **NY BROWNFIELDS** **S132119340**
WNW **500-550 SOUTH SALINA STREET** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.295 mi.
1555 ft. **Site 1 of 3 in cluster AA**

Relative: **Lower**

Actual: **391 ft.**

BROWNFIELDS:

Name:	CHIMES BUILDING
Address:	500-550 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	662655
Acres:	1.255
HW Code:	C734165
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	01/24/2024
Record Updated Date:	04/01/2024
Update By:	AMSERVIS
Site Description:	"Location: The site is located in the central portion of the City of Syracuse commercial district. The 1.255-acre site is surrounded by South Salina Street to the east, West Onondaga Street to the north, South Clinton Street to the west, and an office building to the south. Neighboring development is primarily commercial in nature. The surrounding properties include a parking garage and the Syracuse Transit Hub / CENTRO Bus Station located to the east, across South Salina Street; the Marriott Downton Syracuse hotel to the northeast, across South Salina Street; the Salt City Market to the north, across West Onondaga Street; a rail line that runs north to south to the west, across South Clinton Street; and the United States Department of Veterans Affairs building and parking lot to the south. There are currently no surface water bodies on or adjacent to the subject property. The closest surface water body is Onondaga Creek, located approximately 200 feet west of the site. Onondaga Creek Flows through the area in a general northerly direction and empties into the southern end of Onondaga Lake approximately 2.04 miles north of the site. Onondaga Creek originates in the Tully Lakes watershed and generally flows in a northerly direction through the Tully and Onondaga Valleys. Site Features: The subject property is currently developed with a 12-story steel frame and masonry building that is used for mixed commercial and residential use. The building was constructed in 1927 with an addition added to the southern corner of the building in 1970. The building fronts on South Salina Street and West Onondaga Street. The exterior portions of the property consist of asphalt paved parking lot to the west and south of the building. The parking lot is accessed via South Salina Street to the east and

CHIMES BUILDING (Continued) **S132119340**

is surrounded by a wrought iron or steel fence. The site is located at 399 feet above mean sea level (amsl) on the eastern portion and slopes to a surface elevation of about 393 feet amsl along the lower western portion. Current Zoning and Land Use: The site is currently zoned for Central Business District (MX-5) under the City of Syracuse s City Zoning Ordinance (March 2023). The site s current land use is office building per Onondaga County GIS. The building that occupies the Site is partially occupied by a mix of residential and commercial tenants at this time. The commercial tenants and their operations are as follows: (1) Level 3 Communications, LLC (also known as CenturyLink), occupies space on the second floor for use as a fiber cable hub facility (head end). Their space consists of fiber, electronics, and building mechanicals to regulate room temperature and power equipment. The space does not actively occupy employees, only equipment service employees, as needed. (2) Charter Communications (also known as Spectrum), occupies two spaces in the basement of the building for use as a fiber cable hub facility (head end). Their space consists of fiber, electronics, and building mechanicals to regulate room temperature and power equipment. The space does not actively occupy employees, only equipment service employees, as needed. (3) Northland Communications occupies space on the second and the elevator penthouse for use as a fiber cable hub facility (head end). Their space consists of fiber, electronics, and building mechanicals to regulate room temperature and power equipment. The space does not actively occupy employees, only equipment service employees, as needed. (4) Casa Mia Food LLC operates a retail grocery store/pizzeria on the first floor of the building and utilizes the building for a retail store and food prep area, and backroom merchandise storage area with coolers. The store is actively occupied by employees daily and is open to the public. (5) Metro by T Mobile operates a retail wireless store on the first floor of the building, fronting South Salina Street. Their operation consists of a retail area for cellular telephones and accessories, and a small back room for storage of merchandise. The store is actively occupied by employees daily and is open to the public. (6) Dish Wireless occupies space on the rooftop of the building and their space consists of fiber cable and antennas for use in transmitting cellular wireless signals. The space does not actively occupy employees, only equipment service employees, as needed. The properties surrounding the Site are zoned for a combination of Central Business District (MX-5) and Light Industry and Employment (LI). The properties surrounding the Site have a combination of land uses including office buildings, motor vehicle service, parking garage, public transportation, hotel, row buildings, railroad, and vacant commercial uses. Past Use of the Site: The subject property and surrounding area have a long history of commercial and residential use. Prior to the existing structure, the site was occupied by multiple dwellings on the western portion, stores on the eastern and northeastern portion, and a Women Christian Association home on the southeastern portion. In the early 1900s, some of the dwellings on the northwestern corner of the site had been replaced with stores and a furniture repair shop. The existing Chimes Building was reportedly constructed between 1927 and 1929. By the mid-1900s (c. 1950s), the Chimes Building contained a bank, offices, and store fronts, and the remainder of the property had been redeveloped with a restaurant building located adjacent to the Chimes Building on the north section of the site, another commercial building containing a

CHIMES BUILDING (Continued) **S132119340**

store and restaurant on the northwest portion of the site, and a filling station with two gasoline tanks on the southeastern portion of the site. A dry-cleaning facility was also present on the southeastern portion of the subject property in the 1960s. Site Geology and Hydrogeology: The site is located within the Erie-Ontario Lowlands physiographic province of New York. The surficial geology at and ion the vicinity of the site is mapped as lacustrine silt and clay on the Surficial Geology Map of New York, Finger Lakes Sheet, dated 1986. Lacustrine silt and clay is a generally laminated formation of clay and silt that was deposited in proglacial lakes. These soils are generally calcareous, and variable in thickness, up to 50 meters. The soil lithology observed across the site during past environmental investigations generally consists of an upper layer of historical fill material (HFM), which was comprised of a heterogenous mix of gravel, brick fragments, ash, coal fragments, cinders, and slag. The depth of the HFM ranged in depths from approximately 0.5 feet to 13 feet below ground surface (bgs). This fill material was generally underlain by natural deposits comprised of a mixture of clay/silt, fine to medium sand, and fine to medium gravel and cobble. The bedrock beneath and in the vicinity of the site is mapped as dolostone, shale, gypsum, and salt of the Syracuse Formation on the Geologic Map of New York, Finger Lakes Sheet, dated 1970. Bedrock has not been investigated during previous environmental investigations. The groundwater table ranged from 22 feet to 28 feet bgs across the site. Based on the overserved topography of the site and the surrounding area, it is believed the groundwater on the site and within the vicinity of the site likely flows west toward Onondaga Creek. "

Env Problem:	"Information submitted with the BCP application regarding the environmental condition at the site are currently under review and will be revised as additional information becomes available."
Health Problem:	"Information submitted with the BCP application regarding the conditions at the site are currently under review and will be revised as additional information becomes available."
Dump:	Not reported
Structure:	Not reported
Lagoon:	Not reported
Landfill:	Not reported
Pond:	Not reported
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	Not reported
Record Upd:	Not reported
Updated By:	Not reported
Own Op:	1
Sub Type:	E
Owner Name:	Maarten Jacobs
Owner Company:	Chimes Syracuse LLC
Owner Address:	484 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Dan Smith

CHIMES BUILDING (Continued) **S132119340**

Owner Company:	Onondaga County Public Library Central Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America
Own Op:	4
Sub Type:	E
Owner Name:	Maarten Jacobs
Owner Company:	Chimes Syracuse LLC
Owner Address:	484 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Maarten Jacobs
Owner Company:	Chimes Syracuse LLC
Owner Address:	484 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	2307739
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2024-03-13 09:31:00
Record Updated:	2024-03-13 09:31:00
Updated By:	AYRUSSO

AA117 **500 SOUTH SALINA STREET** **UST FINDER RELEASE** **1029058890**
WNW **500 SOUTH SALINA STREET** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.295 mi.
1555 ft. **Site 2 of 3 in cluster AA**

Relative: **Lower**
Actual: **391 ft.**

UST FINDER RELEASE:

Object ID:	249451
Facility ID:	NY130242
Lust ID:	NY9960057
Name:	500 SOUTH SALINA STREET
Address:	500 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	2000/02/21 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1161
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No

500 SOUTH SALINA STREET (Continued) **1029058890**

WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.15216
Y Coord:	43.0440400000001
Latitude:	43.04404
Longitude:	-76.1521599999999

AB118 **DISTRICT HEATING & COOLING PLANT** **NY LTANKS** **S104514136**
North **601 S STATE ST** **NY Spills** **N/A**
1/4-1/2 **SYRACUSE, NY 13202** **NY AIRS**
0.307 mi. **NY MANIFEST**
1619 ft. **Site 1 of 2 in cluster AB**

Relative: **Lower**
Actual: **397 ft.**

LTANKS:

Name:	STEAM STATION
Address:	601 S. STATE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8602554 / 1988-12-12
Facility ID:	8602554
Site ID:	93875
Spill Date:	1986-07-18
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1988-11-28
SWIS:	3415
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	1986-07-18
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1986-07-25
Spill Record Last Update:	1988-12-12
Spiller Name:	Not reported
Spiller Company:	ONONDAGA COUNTY STEAM STA
Spiller Address:	PAUL ELLARD
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

DER Facility ID: 84107
Latitude: 43.0462538
Longitude: -76.1474007
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was HW
08/18/86: 200-300 GALLONS OF 6 FUEL ENTERED GROUNDWATER VIA TANK FALUIRE. EOI EMPTIED OLD TANK AND RECOVERED SPILLED PRODUCT.
Remarks: ENVIRONMENTAL OIL CO. WAS CALLED BY ONONDAGA COUNTY STEAM STATION & RESPONDED. GROUNDWATER CLEANUP BEING PERFORMED.

All Materials:
Site ID: 93875
Operable Unit ID: 899836
Operable Unit: 01
Material ID: 478984
Material Code: 0003A
Material Name: #6 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 200.00
Units: G
Recovered: .00
Resource Affected: Groundwater
Oxygenate: Not reported

SPILLS:
Name: STEAM STATION-S.STATE ST.
Address: 601 S. STATE ST
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 9106022 / 1991-09-05
Facility ID: 9106022
Facility Type: ER
DER Facility ID: 84107
Site ID: 190544
DEC Region: 7
Spill Cause: Equipment Failure
Spill Class: C3
SWIS: 3415
Spill Date: 1986-09-04
Investigator: ROMOCKI
Referred To: Not reported
Reported to Dept: 1991-09-04
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: 1991-09-05
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: True
Remediation Phase: 0
Date Entered In Computer: 1991-09-04
Spill Record Last Update: 1991-09-05
Spiller Name: Not reported
Spiller Company: ONON. CO. STEAM STATION
Spiller Address: 601 S.STATE ST.

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0462538
Longitude:	-76.1474007
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 09/04/91: CONTRACTOR WILL ATTEMPT TO EXCAVATE CONTAMINATED SOIL. 09/05/91: CONTAMINATED SOIL EXCAVATED AND STAGED ON SITE. SOIL SAMPLES TO BE TAKEN FROM WALL OF EXCAVATION TO DOCUMENT CONDITIONS AFTER EXCAVATING.
Remarks:	CONTAMINATED SOIL DISCOVERED DURING TANK REMOVAL.

All Materials:

Site ID:	190544
Operable Unit ID:	960360
Operable Unit:	01
Material ID:	421774
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	25.00
Units:	G
Recovered:	25.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	STEAM PLANT GARAGE
Address:	601 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2307378 / 2023-12-20
Facility ID:	2307378
Facility Type:	ER
DER Facility ID:	604827
Site ID:	659433
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D2
SWIS:	3442
Spill Date:	2023-12-06
Investigator:	DGMILLER
Referred To:	Not reported
Reported to Dept:	2023-12-06
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2023-12-06
Spill Record Last Update:	2023-12-20
Spiller Name:	JESSE
Spiller Company:	ONONDAGA CO

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Spiller Address: 601 SOUTH STATE ST
Spiller Company: 999
Contact Name: JESSE
Latitude: Not reported
Longitude: Not reported
DEC Memo: Cleaned up by rp
Remarks: Clean up pending

All Materials:
Site ID: 659433
Operable Unit ID: 1406269
Operable Unit: 01
Material ID: 2423654
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: .50
Units: G
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: Not reported

AIRS:
Name: DISTRICT HEATING & COOLING PLANT
Address: 601 S STATE ST
City,State,Zip: SYRACUSE, NY 13202
DECID: 7311500112
Process ID: Not reported
Latitude: Not reported
Longitude: Not reported
FIPS Code: Not reported
Auth Type Code: AFR

Permit Status: Issued
Auth Status Code: 2
Emissions: Not reported
Issue date: 06/11/2008
Expired Date: Not reported
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

Permit Status: Expired
Auth Status Code: 7
Emissions: Not reported
Issue date: 07/05/2006
Expired Date: 06/11/2008
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Permit Status:	Expired
Auth Status Code:	7
Emissions:	Not reported
Issue date:	03/08/2004
Expired Date:	07/05/2006
Emission Unit date:	Not reported
Contamination:	Not reported
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	Not reported

NY MANIFEST:

EPA ID:	NY0000033688
Country:	USA
Name:	SYRACUSE CITY OF PUBLIC SERVICE BUILDING
Address:	601 SOUTH STATE ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	601 SOUTH STATE ST
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	SYRACUSE CITY OF PUBLIC SERVICE BUILDING
Mailing Contact:	ROGER WIDAY
Mailing Address 1:	511 S STATE ST
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154358367

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	05/26/2009
Trans1 Recv Date:	05/26/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/12/2009
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD010154045
TSDF ID 2:	Not reported
Manifest Tracking Number:	000634225JJK
Import Indicator:	N
Export Indicator:	N

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	LEAD
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	750
Units:	Pounds
Number of Containers:	2
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	05/26/2009
Trans1 Recv Date:	05/26/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/12/2009
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD010154045
TSDF ID 2:	Not reported
Manifest Tracking Number:	000634225JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	LEAD

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1100
Units:	Pounds
Number of Containers:	3
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	VTA0064296
Manifest Status:	Not reported
Trans1 State ID:	NYPD7793
Year:	1994
Trans2 State ID:	Not reported
Generator Ship Date:	06/14/1994
Trans1 Recv Date:	06/14/1994
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/20/1994
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	NYD012928347
Trans2 EPA ID:	Not reported
TSDF ID 1:	VTD982766537
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	LEAD
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00050
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Specific Gravity:	01.00
Document ID:	MAH7549900
Manifest Status:	Not reported
Trans1 State ID:	13908MA
Year:	1995
Trans2 State ID:	4938BSOK
Generator Ship Date:	11/13/1995
Trans1 Recv Date:	11/13/1995
Trans2 Recv Date:	11/20/1995
TSD Site Recv Date:	11/20/1995
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	MAD000604447
Trans2 EPA ID:	ARD981908551
TSDF ID 1:	MAD000604447
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	POTASSIUM CYANIDE (OR) POTASSIUM CYANIDE K(CN)
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Document ID:	PAC8097202
Manifest Status:	Not reported
Trans1 State ID:	PAAH0147
Year:	1993
Trans2 State ID:	Not reported
Generator Ship Date:	12/02/1993
Trans1 Recv Date:	12/02/1993
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/03/1993
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	NYD051809952
Trans2 EPA ID:	Not reported

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	LEAD
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00055
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	06/25/2010
Trans1 Recv Date:	06/25/2010
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/12/2010
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	002472766FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H132
Waste Code a:	B007
Waste Code b:	Not reported

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	160
Units:	Kilograms
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/24/2011
Trans1 Recv Date:	02/24/2011
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/28/2011
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD085690592
TSDF ID 2:	Not reported
Manifest Tracking Number:	003548146FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H071
Waste Code a:	CHROMIUM
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Quantity:	1536
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Treat
Specific Gravity:	1
Document ID:	NYB7540893
Manifest Status:	Not reported
Trans1 State ID:	13908MA
Year:	1995
Trans2 State ID:	98115FNY
Generator Ship Date:	11/13/1995
Trans1 Recv Date:	11/13/1995
Trans2 Recv Date:	11/14/1995
TSD Site Recv Date:	11/14/1995
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	NYD982792814
Trans2 EPA ID:	NYD982792814
TSDF ID 1:	NYD000632372
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	CORROSIVE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Waste Code 7:	REACTIVE WASTE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Specific Gravity:	01.00
Waste Code 12:	IGNITABLE WASTE
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYB7540902
Manifest Status:	Not reported
Trans1 State ID:	13908MA
Year:	1995
Trans2 State ID:	5245BFOK
Generator Ship Date:	11/13/1995
Trans1 Recv Date:	11/13/1995
Trans2 Recv Date:	11/15/1995
TSD Site Recv Date:	11/16/1995
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	MAD000604447
Trans2 EPA ID:	ARD981908551
TSDF ID 1:	NCD000648451
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	BENZENE, 1,1'-(2,2,2-TRICHLOROETHYLIDENE)BIS[4-CHLORO- (OR) DDT
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	2,4-DINITROPHENOL (OR) PHENOL, 2,4-DINITRO-
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Waste Code 11:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	IGNITABLE WASTE
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	REACTIVE WASTE
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYB6726231
Manifest Status:	Not reported
Trans1 State ID:	R39387ME
Year:	1995
Trans2 State ID:	Not reported
Generator Ship Date:	02/28/1995
Trans1 Recv Date:	02/28/1995
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	03/04/1995
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	CTD982191942
Trans2 EPA ID:	Not reported
TSDF ID 1:	OHD980700942
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

MGMT Method Type Code:	Not reported
Waste Code 1:	LEAD
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00050
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

AB119 **STEAM STATION-S.STATE ST.** **UST FINDER RELEASE** **1029078785**
North **601 S. STATE ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.307 mi.
1619 ft. **Site 2 of 2 in cluster AB**

Relative: **Lower**

Actual: **397 ft.**

UST FINDER RELEASE:

Object ID:	249477
Facility ID:	NY84107
Lust ID:	NY9106022
Name:	STEAM STATION-S.STATE ST.
Address:	601 S. STATE ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1986/09/04 16:00:00+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1605
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1473999999999
Y Coord:	43.04625
Latitude:	43.04625
Longitude:	-76.1474

Z120 **CATHEDRAL IMMACULATE CON.** **NY LTANKS** **S102677622**
NNW **420 MONTGOMERY AVE** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.309 mi.
1634 ft. **Site 2 of 2 in cluster Z**

Relative:
Lower

Actual:
394 ft.

LTANKS:

Name:	CATHEDRAL IMMACULATE CON.
Address:	420 MONTGOMERY AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8709428 / 1988-02-05
Facility ID:	8709428
Site ID:	317505
Spill Date:	1988-02-05
Spill Cause:	Tank Overfill
Spill Source:	Tank Truck
Spill Class:	Not reported
Cleanup Ceased:	1988-02-05
SWIS:	3415
Investigator:	VOLLMER
Referred To:	Not reported
Reported to Dept:	1988-02-05
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1988-02-22
Spill Record Last Update:	1988-02-22
Spiller Name:	Not reported
Spiller Company:	MOHAWK VALLEY OIL
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	255926
Latitude:	43.0464912
Longitude:	-76.1488662
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was DV 02/05/88: CLEANED UP BY SPILLER.
Remarks:	CLEANED WITH SORBENT BY SPILLER.

All Materials:

Site ID:	317505
Operable Unit ID:	914844
Operable Unit:	01
Material ID:	464751
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	2.00
Units:	G
Recovered:	.00
Resource Affected:	Soil

CATHEDRAL IMMACULATE CON. (Continued) **S102677622**

Oxygenate: Not reported

121
West
1/4-1/2
0.312 mi.
1649 ft.

Relative:
Lower

Actual:
390 ft.

BYRNE DAIRY INC.
240 ONEIDA STREET
SYRACUSE, NY 13202

NY LTANKS **U003313193**
NY UST **N/A**
NY CBS
NY AST
NY Spills
NY SPDES

LTANKS:

Name:	BYRNE DAIRY
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9703387 / 1997-06-30
Facility ID:	9703387
Site ID:	109079
Spill Date:	1997-06-11
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	D4
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1997-06-11
CID:	999
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1997-06-18
Spill Record Last Update:	1997-06-18
Spiller Name:	RON STODDARD
Spiller Company:	BYRNE DAIRY
Spiller Address:	240 ONEIDA ST
Spiller County:	001
Spiller Contact:	RON STODDARD
Spiller Phone:	(315) 475-2111
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	142067
Latitude:	43.0418211
Longitude:	-76.1538985
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	DURING EXCAVATION FOR ADDITION TO FACTORY UNCOVERED LIMITED AMOUNT OF CONTAMINAED SOIL FROM TANK REMOVAL - OLD SPILL NO. 87-8332 .O5 YRD

Name:	BYRNE DAIRY
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8708332 / 1988-02-04
Facility ID:	8708332
Site ID:	168673
Spill Date:	1987-12-28

BYRNE DAIRY INC. (Continued) **U003313193**

Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Cleanup Ceased:	1988-02-04
SWIS:	3415
Investigator:	AJMARSCH
Referred To:	Not reported
Reported to Dept:	1987-12-28
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1988-01-05
Spill Record Last Update:	1988-02-08
Spiller Name:	Not reported
Spiller Company:	BYRNE DAIRY
Spiller Address:	NEIL MCLAIN
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	142067
Latitude:	43.0418211
Longitude:	-76.1538985
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was JM / / : TANKS WERE ABANDONED AND FILLED IN PLACE ON 01/07/88. NO CONTAMINATION FOUND. TANKS WERE MANIFOLDED TOGETHER.
Remarks:	TWO 3,000 GAL. TANKS MANIFOLDED TOGETHER. FAILURE RATE UNKNOWN.

All Materials:

Site ID:	168673
Operable Unit ID:	912967
Operable Unit:	01
Material ID:	463723
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

Name:	BYRNE DAIRY
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9804457 / 2000-11-08
Facility ID:	9804457
Site ID:	64142
Spill Date:	1998-07-09
Spill Cause:	Tank Overfill

BYRNE DAIRY INC. (Continued) **U003313193**

Spill Source:	Commercial/Industrial
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	1998-07-09
CID:	204
Water Affected:	Not reported
Spill Notifier:	Local Agency
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1998-07-09
Spill Record Last Update:	2000-11-08
Spiller Name:	JOHN MCNANARA
Spiller Company:	BYRNE DAIRY
Spiller Address:	240 ONIEDA STREET
Spiller County:	001
Spiller Contact:	JOHN HERMAN
Spiller Phone:	(315) 697-8437
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	142067
Latitude:	43.0418211
Longitude:	-76.1538985
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was HW
Remarks:	CONTAMINATION FOUND IN SPILL AREA

UST:

Name:	BYRNE DAIRY INC.
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-162175 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	405992.32117
UTM Y:	4766113.61803
Site Type:	Manufacturing (Other than Chemical)/Processing

Affiliation Records:

Site Id:	44909
Affiliation Type:	Facility Owner
Company Name:	BYRNE DAIRY INC.
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	240 ONEIDA ST.
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 475-2111

BYRNE DAIRY INC. (Continued) **U003313193**

EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 44909
Affiliation Type: Mail Contact
Company Name: BYRNE DAIRY INC.
Contact Type: Not reported
Contact Name: JOHN MCNAMARA
Address1: 240 ONEIDA ST.
Address2: Not reported
City: SYRACUSE
State: NY
Zip Code: 13202
Country Code: 001
Phone: (315) 475-2111
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 44909
Affiliation Type: Facility Operator
Company Name: BYRNE DAIRY INC.
Contact Type: Not reported
Contact Name: BYRNE DAIRY INC.
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (315) 475-2111
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 44909
Affiliation Type: Emergency Contact
Company Name: BYRNE DAIRY INC.
Contact Type: Not reported
Contact Name: JOHN MCNAMARA
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (315) 475-2121
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

BYRNE DAIRY INC. (Continued) **U003313193**

Tank Info:

Tank Number:	001
Tank ID:	129206
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	4000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number:	002
Tank ID:	129207
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	10000
Install Date:	05/01/1974
Date Tank Closed:	07/01/1998
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0008
Common Name of Substance:	Diesel
Tightness Test Method:	03
Date Test:	11/01/1996
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

BYRNE DAIRY INC. (Continued) **U003313193**

B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number:	003
Tank ID:	129208
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	3000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number:	004
Tank ID:	129209
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	3000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI

BYRNE DAIRY INC. (Continued) **U003313193**

Last Modified: 05/09/2022

Equipment Records:

A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

CBS:

Name:	BYRNE DAIRY
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY 13202
CBS Number:	7-000339
Program Type:	CBS
Facility Status:	Unregulated/Closed
Expiration Date:	Not reported
Dec Region:	7
UTMX:	406024.08117
UTMY:	4766063.70714

Name:	UPSTATE FARMS DAIRY, LLC
Address:	240 ONEIDA ST
City,State,Zip:	SYRACUSE, NY 13202
CBS Number:	7-000299
Program Type:	CBS
Facility Status:	Active
Expiration Date:	11/29/2025
Dec Region:	7
UTMX:	405992.32117
UTMY:	4766113.61803

AST:

Name:	BYRNE DAIRY
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY 13202
Region:	STATE
DEC Region:	7
Site Status:	Unregulated/Closed
Facility Id:	7-000339
Program Type:	CBS
UTM X:	406024.08117
UTM Y:	4766063.70714
Expiration Date:	N/A
Site Type:	Manufacturing (Other than Chemical)/Processing

Tank Info:

Tank Number:	54-1050-1
Tank Id:	195202
Tank Location:	Aboveground - contact with impervious barrier... Tank bottom rests on impervious barrier, allowing visual indication of leaks.
Tank Type:	Plastic

BYRNE DAIRY INC. (Continued) **U003313193**

Tank Status:	Administratively Closed
Pipe Model:	Not reported
Install Date:	11/01/2003
Capacity Gallons:	685
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	12/02/2015
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

SPILLS:

Name:	BYRNE DAIRY
Address:	240 ONEIDA ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1308782 / 2014-01-07
Facility ID:	1308782
Facility Type:	ER
DER Facility ID:	360242
Site ID:	489538
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2013-12-02
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2013-12-02
CID:	Not reported
Water Affected:	NONE
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	2014-01-07
Cleanup Meets Std:	True
Last Inspection:	2013-12-02
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2013-12-02
Spill Record Last Update:	2014-01-07
Spiller Name:	TOM CORP
Spiller Company:	BYRNE DAIRY
Spiller Address:	240 ONEIDA ST
Spiller Company:	999
Contact Name:	TOM CORP
Latitude:	43.0414316
Longitude:	-76.1537268
DEC Memo:	12/02/2013 - Dock leveller being tested burst hydraulic hose, spilling approx 3 gallons non-PCB hydraulic oil to concrete and pavement. Spill booms and absorbent used to prevent spilled oil from reaching sotrm drainage system. EP&S contracted to clean area after hydraulics were repaired. BECI Donk advised. KCKemp 1/7/2014 - Disposal receipt and bill of lading rec4eived and filed. Spill

BYRNE DAIRY INC. (Continued) **U003313193**

	closed. BECI Donk advised. KCKemp
Remarks:	Loss to pavement, c/u pending

All Materials:

Site ID:	489538
Operable Unit ID:	1239116
Operable Unit:	01
Material ID:	2239085
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3.00
Units:	G
Recovered:	3.00
Resource Affected:	Impervious Surface
Oxygenate:	Not reported

Name:	240 ONEIDA ST
Address:	240 ONEIDA ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1008505 / 2010-11-15
Facility ID:	1008505
Facility Type:	ER
DER Facility ID:	397022
Site ID:	441997
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2010-11-14
Investigator:	cxrossi
Referred To:	Not reported
Reported to Dept:	2010-11-14
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	2010-11-14
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2010-11-14
Spill Record Last Update:	2010-11-15
Spiller Name:	CHRISTIAN BRUNELLE
Spiller Company:	BYRNE DAIRY
Spiller Address:	240 ONEIDA ST
Spiller Company:	999
Contact Name:	PAUL SPENCER
Latitude:	43.0414316
Longitude:	-76.1537268
DEC Memo:	Byrne Dairy garbage truck broke a hydraulic line. Fluid spread to surrounding pavement, roadway,and two catch basins. Plant workers cleaned up pavement with speedy dry and cleaned the furthermost

BYRNE DAIRY INC. (Continued) **U003313193**

affected catch basin with absorbent pads. Catch basin next to building which received a great
amount, flows back to plant to be treated with other milk waste materials and then discharges to
sanitary sewer according to CHRISTIAN BRUNELLE. ~ctr~ 11/15/10

Remarks: Caller advised hydraulic fluid spilled onto pavement. Clean up is in process.

All Materials:

Site ID:	441997
Operable Unit ID:	1192529
Operable Unit:	01
Material ID:	2187859
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	25.00
Units:	G
Recovered:	25.00
Resource Affected:	Soil, Sewer
Oxygenate:	Not reported

SPDES:

Name:	Byrne Dairy Fluid Milk Plant
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY 13202-3373
Permit Number:	NYR00E675
State-Region:	07
Expiration Date:	09/30/2017
Current Major Minor Status:	Minor
Primary Facility SIC Code:	2026
State Water Body Name:	ONONDAGA CREEK
Limit Set Status Flag:	Active
Total Actual Average Flow(MGD):	Not reported
Total App Design Flow(MGD):	Not reported
UDF1:	Not reported
Lat/Long:	+43.041 / -76.153
DMR Cognizant Official:	Not reported
UDF2:	Not reported
UDF3:	Not reported
FIPS County Code:	NY067

Non-Gov Permit Affiliation Type Desc:	Billing
Non-Gov Permit Org Formal Name:	TOM CORP
Non-Gov Permit Street Address:	ULTRA DAIRY 6700 WEST BENEDICT RD
Non-Gov Permit Supplemental Location:	Not reported
Non-Gov Permit City:	EAST SYRACUSE
Non-Gov Permit State Code:	NY
Non-Gov Permit Zip Code:	13057
Non-Gov Facility Affiliation Type Desc:	Owner
Non-Gov Facility Org Formal Name:	BYRNE DAIRY INC
Non-Gov Facility Street Address:	BYRNE DAIRY FLUID MILK PLANT
Non-Gov Facility Supplemental Location:	2394 US RTE 11
Non-Gov Facility City:	LAFAYETTE

BYRNE DAIRY INC. (Continued) **U003313193**

Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	13084
State Water Body:	Not reported
Region Permit Processed:	Not reported
Dow Discharge Class Code:	Not reported
SPDES Class Description:	Not reported
Affiliation Type Description:	Not reported
Name:	Not reported
Contacts Title:	Not reported
Contacts Email:	Not reported
NOI Submission Date:	Not reported
Facility Type:	Not reported
Name:	Byrne Dairy Fluid Milk Plant
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY 13202-3373
UDF2:	Not reported
UDF3:	Not reported
FIPS County Code:	NY067
Non-Gov Permit Affiliation Type Desc:	DMR Mailing Address
Non-Gov Permit Org Formal Name:	TOM CORP
Non-Gov Permit Street Address:	BYRNE DAIRY FLUID MILK PLANT
Non-Gov Permit Supplemental Location:	ULTRA DAIRY 6700 WEST BENEDICT RD
Non-Gov Permit City:	EAST SYRACUSE
Non-Gov Permit State Code:	NY
Non-Gov Permit Zip Code:	13057
Non-Gov Facility Affiliation Type Desc:	Owner
Non-Gov Facility Org Formal Name:	BYRNE DAIRY INC
Non-Gov Facility Street Address:	BYRNE DAIRY FLUID MILK PLANT
Non-Gov Facility Supplemental Location:	2394 US RTE 11
Non-Gov Facility City:	LAFAYETTE
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	13084
State Water Body:	Not reported
Region Permit Processed:	Not reported
Dow Discharge Class Code:	Not reported
SPDES Class Description:	Not reported
Affiliation Type Description:	Not reported
Name:	Not reported
Contacts Title:	Not reported
Contacts Email:	Not reported
NOI Submission Date:	Not reported
Facility Type:	Not reported
Name:	Byrne Dairy Fluid Milk Plant
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY 13202-3373
UDF2:	Not reported
UDF3:	Not reported
FIPS County Code:	NY067
Non-Gov Permit Affiliation Type Desc:	Permittee
Non-Gov Permit Org Formal Name:	BYRNE DAIRY INC
Non-Gov Permit Street Address:	2394 US 11
Non-Gov Permit Supplemental Location:	Not reported
Non-Gov Permit City:	LAFAYETTE

BYRNE DAIRY INC. (Continued) **U003313193**

Non-Gov Permit State Code:	NY
Non-Gov Permit Zip Code:	13084
Non-Gov Facility Affiliation Type Desc:	Owner
Non-Gov Facility Org Formal Name:	BYRNE DAIRY INC
Non-Gov Facility Street Address:	BYRNE DAIRY FLUID MILK PLANT
Non-Gov Facility Supplemental Location:	2394 US RTE 11
Non-Gov Facility City:	LAFAYETTE
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	13084
State Water Body:	Not reported
Region Permit Processed:	Not reported
Dow Discharge Class Code:	Not reported
SPDES Class Description:	Not reported
Affiliation Type Description:	Not reported
Name:	Not reported
Contacts Title:	Not reported
Contacts Email:	Not reported
NOI Submission Date:	Not reported
Facility Type:	Not reported

Name:	Byrne Dairy Fluid Milk Plant
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY 13202-3373
UDF2:	Not reported
UDF3:	Not reported
FIPS County Code:	NY067

Non-Gov Permit Affiliation Type Desc:	Not reported
Non-Gov Permit Org Formal Name:	Not reported
Non-Gov Permit Street Address:	Not reported
Non-Gov Permit Supplemental Location:	Not reported
Non-Gov Permit City:	Not reported
Non-Gov Permit State Code:	Not reported
Non-Gov Permit Zip Code:	Not reported
Non-Gov Facility Affiliation Type Desc:	Owner
Non-Gov Facility Org Formal Name:	BYRNE DAIRY INC
Non-Gov Facility Street Address:	BYRNE DAIRY FLUID MILK PLANT
Non-Gov Facility Supplemental Location:	2394 US RTE 11
Non-Gov Facility City:	LAFAYETTE
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	13084
State Water Body:	Not reported
Region Permit Processed:	Not reported
Dow Discharge Class Code:	Not reported
SPDES Class Description:	Not reported
Affiliation Type Description:	Not reported
Name:	Not reported
Contacts Title:	Not reported
Contacts Email:	Not reported
NOI Submission Date:	Not reported
Facility Type:	Not reported

Name:	Upstate Farms Dairy, Llc
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY 13202
UDF2:	Not reported
UDF3:	Not reported

BYRNE DAIRY INC. (Continued) **U003313193**

FIPS County Code:	Not reported
Non-Gov Permit Affiliation Type Desc:	Not reported
Non-Gov Permit Org Formal Name:	Not reported
Non-Gov Permit Street Address:	Not reported
Non-Gov Permit Supplemental Location:	Not reported
Non-Gov Permit City:	Not reported
Non-Gov Permit State Code:	Not reported
Non-Gov Permit Zip Code:	Not reported
Non-Gov Facility Affiliation Type Desc:	Not reported
Non-Gov Facility Org Formal Name:	Not reported
Non-Gov Facility Street Address:	Not reported
Non-Gov Facility Supplemental Location:	Not reported
Non-Gov Facility City:	Not reported
Non-Gov Facility State Code:	Not reported
Non-Gov Facility Zip Code:	Not reported
State Water Body:	Not reported
Region Permit Processed:	Not reported
Dow Discharge Class Code:	Not reported
SPDES Class Description:	Not reported
Affiliation Type Description:	Not reported
Name:	Not reported
Contacts Title:	Not reported
Contacts Email:	Not reported
NOI Submission Date:	Not reported
Facility Type:	Not reported

AA122 **COUNTY SEWER ROW** **UST FINDER RELEASE** **1029074682**
WNW **CLINTON AND WEST ONONDAGA ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.326 mi.
1722 ft. **Site 3 of 3 in cluster AA**

Relative: **Lower**
Actual: **391 ft.**

UST FINDER RELEASE:

Object ID:	249443
Facility ID:	NY335966
Lust ID:	NY706121
Name:	COUNTY SEWER ROW
Address:	CLINTON AND WEST ONONDAGA ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	2007/08/29 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	983
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported

COUNTY SEWER ROW (Continued) **1029074682**

EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.15325
Y Coord:	43.0436300000001
Latitude:	43.04363
Longitude:	-76.15325

AC123 **500 WARREN ST** **UST FINDER RELEASE** **1029067783**
NNW **500 WARREN ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.333 mi.
1757 ft. **Site 1 of 2 in cluster AC**

Relative: **Lower**

Actual: **392 ft.**

UST FINDER RELEASE:

Object ID:	249456
Facility ID:	NY239034
Lust ID:	NY9810139
Name:	500 WARREN ST
Address:	500 WARREN ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1998/11/11 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1575
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1509
Y Coord:	43.0454300000001
Latitude:	43.04543
Longitude:	-76.1508999999999

AC124 **HOTEL SYRACUSE** **RCRA-VSQG** **1000117279**
NNW **500 S WARREN ST** **NY LTANKS** **NYD085169555**
1/4-1/2 **SYRACUSE, NY 13202** **US AIRS**
0.333 mi. **NY MANIFEST**
1757 ft. **Site 2 of 2 in cluster AC**

Relative: **Lower**
Actual: **392 ft.**

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	Hotel Syracuse
Handler Address:	S Warren St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYD085169555
Contact Name:	JIM FOOKS
Contact Address:	S WARREN ST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-422-5121
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	S WARREN ST
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Allegro Corp
Owner Type:	Private
Operator Name:	Allegro Corp
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No

HOTEL SYRACUSE (Continued) **1000117279**

Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	D008
Waste Description:	Lead
Waste Code:	D018
Waste Description:	Benzene
Waste Code:	D025
Waste Description:	P-Cresol
Waste Code:	D039
Waste Description:	Tetrachloroethylene
Waste Code:	D040
Waste Description:	Trichloroethylene
Waste Code:	F003
Waste Description:	The Following Spent Nonhalogenated Solvents: Xylene, Acetone, Ethyl Acetate, Ethyl Benzene, Ethyl Ether, Methyl Isobutyl Ketone, N-Butyl Alcohol, Cyclohexanone, And Methanol; All Spent Solvent Mixtures/Blends Containing, Before Use, Only The Above Spent Nonhalogenated Solvents; And All Spent Solvent Mixtures/Blends Containing, Before Use, One Or More Of The Above Nonhalogenated Solvents, And A Total Of Ten Percent Or More (By Volume) Of One Or More Of Those Solvents Listed In F001, F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code:	F005
Waste Description:	The Following Spent Nonhalogenated Solvents: Toluene, Methyl Ethyl Ketone, Carbon Disulfide, Isobutanol, Pyridine, Benzene, 2-Ethoxyethanol, And 2-Nitropropane; All Spent Solvent Mixtures/Blends Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Nonhalogenated Solvents Or Those Solvents Listed In F001, F002, Or F004; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.

HOTEL SYRACUSE (Continued) **1000117279**

Waste Code: X001
Waste Description: Not Defined

Handler - Owner Operator:
Owner/Operator Indicator: Operator
Owner/Operator Name: ALLEGRO CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 500 S WARREN ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-422-5121
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: ALLEGRO CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 500 S WARREN ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-422-5121
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: ALLEGRO CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 500 S WARREN ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-422-5121
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20060101
Handler Name: HOTEL SYRACUSE
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: HOTEL SYRACUSE

HOTEL SYRACUSE (Continued) **1000117279**

Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20000614
Handler Name: HOTEL SYRACUSE	
Federal Waste Generator Description:	Small Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

LTANKS:

Name:	500 WARREN ST
Address:	500 WARREN ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9810139 / 2000-04-24
Facility ID:	9810139
Site ID:	295387
Spill Date:	1998-11-11
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	1999-04-01
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1998-11-11
CID:	257
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	True

HOTEL SYRACUSE (Continued) **1000117279**

Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1998-11-11
Spill Record Last Update:	2000-04-25
Spiller Name:	PATRICIA FOSDICK
Spiller Company:	PATRICIA FOSDICK
Spiller Address:	11527 MEASHERWELL
Spiller County:	001
Spiller Contact:	LT CAVUTO
Spiller Phone:	(315) 473-5671
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	239034
Latitude:	43.0454263
Longitude:	-76.1508967
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	removed 9 gals of fuel from a leaking tuel tank ans fuel to be deposited in recovery drum

US AIRS (AFS):

Region Code:	02
County Code:	NY067
Programmatic ID:	AIR NY0000007311500076
Facility Registry ID:	110001578926
D and B Number:	Not reported
Facility Site Name:	HOTEL SYRACUSE
Primary SIC Code:	7011
NAICS Code:	999999
Default Air Classification Code:	SMI
Facility Type of Ownership Code:	POF
Air CMS Category Code:	Not reported
HPV Status:	Not reported

US AIRS (AFS):

Region Code:	02
Programmatic ID:	AIR NY0000007311500076
Facility Registry ID:	110001578926
Air Operating Status Code:	OPR
Default Air Classification Code:	SMI

Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	1990-01-29 00:00:00
Activity Status Date:	Not reported
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Not reported

Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	1989-03-03 00:00:00
Activity Status Date:	Not reported
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Not reported

Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	1987-12-22 00:00:00

HOTEL SYRACUSE (Continued) **1000117279**

Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1987-01-14 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1985-12-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1985-03-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1983-12-08 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1982-01-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

NY MANIFEST:
EPA ID: NYD085169555
Country: USA
Name: HOTEL SYRACUSE
Address: 500 S WARREN ST
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported
Location Address 1: 500 SOUTH WARREN ST
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

HOTEL SYRACUSE (Continued) **1000117279**

Mailing:
- Mailing Name: HOTEL SYRACUSE
- Mailing Contact: DENISE VAN MARTER
- Mailing Address 1: 500 SOUTH WARREN ST
- Mailing Address 2: Not reported
- Mailing City,State,Zip: SYRACUSE, NY 13202
- Mailing Zip 4: Not reported
- Mailing Country: USA
- Mailing Phone: 3154225121

Manifest Data:
- Document ID: ILA9015058
- Manifest Status: Not reported
- Trans1 State ID: UPW151288
- Year: 2000
- Trans2 State ID: UPW203954
- Generator Ship Date: 07/31/2000
- Trans1 Recv Date: 07/31/2000
- Trans2 Recv Date: 08/03/2000
- TSD Site Recv Date: 08/08/2000
- Part A Recv Date: Not reported
- Part B Recv Date: Not reported
- Generator EPA ID: NYD085169555
- Trans1 EPA ID: SCR000075150
- Trans2 EPA ID: SCR000074591
- TSDF ID 1: ILD980613913
- TSDF ID 2: Not reported
- Manifest Tracking Number: Not reported
- Import Indicator: Not reported
- Export Indicator: Not reported
- Discr Quantity Indicator: Not reported
- Discr Type Indicator: Not reported
- Discr Residue Indicator: Not reported
- Discr Partial Reject Indicator: Not reported
- Discr Full Reject Indicator: Not reported
- Manifest Ref Number: Not reported
- Alt Facility RCRA ID: Not reported
- Alt Facility Sign Date: Not reported
- MGMT Method Type Code: Not reported
- Waste Code 1: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- Waste Code 2: Not reported
- Waste Code 3: Not reported
- Waste Code 4: Not reported
- Waste Code 5: Not reported
- Waste Code 6: Not reported
- Quantity: 00892
- Units: Pounds
- Number of Containers: 003
- Container Type: Metal drums, barrels, kegs
- Handling Method: Burn

HOTEL SYRACUSE (Continued) **1000117279**

Specific Gravity:	01.00
Document ID:	NYC7164977
Manifest Status:	Not reported
Trans1 State ID:	NY18096JB
Year:	2003
Trans2 State ID:	1218B7NY
Generator Ship Date:	12/12/2003
Trans1 Recv Date:	12/12/2003
Trans2 Recv Date:	12/16/2003
TSD Site Recv Date:	12/18/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD085169555
Trans1 EPA ID:	TXR000050930
Trans2 EPA ID:	NYD980769947
TSDF ID 1:	KYD053348108
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00500
Units:	Pounds
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
EPA ID:	NYD981133390
Country:	USA
Name:	HOTELS AT SYRACUSE SQUARE THE
Address:	500 S WARREN ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	500 S WARREN ST
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported

HOTEL SYRACUSE (Continued) **1000117279**

Code: BP

Mailing:
Mailing Name: HOTELS AT SYRACUSE SQUARE THE
Mailing Contact: HOTEL SYRACUSW RESTORATION
Mailing Address 1: 500 S WARREN ST
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3153916326

Manifest Data:
Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NYD986980753
Year: 2018
Trans2 State ID: Not reported
Generator Ship Date: 10/30/2015
Trans1 Recv Date: 10/30/2015
Trans2 Recv Date: Not reported
TSD Site Recv Date: 11/06/2015
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981133390
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: PAD067098822
TSDF ID 2: Not reported
Manifest Tracking Number: 004946142FLE
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H141
Waste Code a: IGNITABLE WASTE
Waste Code b: Not reported
Waste Code c: Not reported
Waste Code e: Not reported
Waste Code f: Not reported
Waste Code g: Not reported
Waste Code 1: Not reported
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 20
Units: Pounds
Number of Containers: 1
Container Type: Metal drums, barrels, kegs

HOTEL SYRACUSE (Continued) **1000117279**

Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	10/30/2015
Trans1 Recv Date:	10/30/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/06/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946143FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	MERCURY
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	15
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	10/30/2015
Trans1 Recv Date:	10/30/2015

HOTEL SYRACUSE (Continued) **1000117279**

Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/06/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946143FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	LEAD
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	120
Units:	Gallons (liquids only)
Number of Containers:	4
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	10/30/2015
Trans1 Recv Date:	10/30/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/06/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946143FLE

HOTEL SYRACUSE (Continued) **1000117279**

Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	IGNITABLE WASTE
Waste Code b:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code c:	Not reported
Waste Code e:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	12
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	10/30/2015
Trans1 Recv Date:	10/30/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/06/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390

HOTEL SYRACUSE (Continued) **1000117279**

Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946143FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	CORROSIVE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	30
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	NYD013277454
Generator Ship Date:	08/17/2015
Trans1 Recv Date:	08/17/2015
Trans2 Recv Date:	08/18/2015
TSD Site Recv Date:	08/18/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	008231919FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N

HOTEL SYRACUSE (Continued) **1000117279**

Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	METHANE, TRICHLOROFLUORO- (OR) TRICHLOROMONOFLUOROMETHANE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	60
Units:	Gallons (liquids only)
Number of Containers:	2
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	09/01/2015
Trans1 Recv Date:	09/01/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/10/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	001161978GBF
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	CORROSIVE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported

HOTEL SYRACUSE (Continued) **1000117279**

Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	200
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	09/01/2015
Trans1 Recv Date:	09/01/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/10/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946151FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	CORROSIVE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	60
Units:	Pounds

HOTEL SYRACUSE (Continued) **1000117279**

Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	09/01/2015
Trans1 Recv Date:	09/01/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/10/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946151FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	CORROSIVE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	30
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported

HOTEL SYRACUSE (Continued) **1000117279**

Generator Ship Date:	09/01/2015
Trans1 Recv Date:	09/01/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/10/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946151FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	CORROSIVE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	50
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	09/01/2015
Trans1 Recv Date:	09/01/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/10/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822

HOTEL SYRACUSE (Continued) **1000117279**

TSDF ID 2:	Not reported
Manifest Tracking Number:	004946152FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	CORROSIVE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	50
Units:	Gallons (liquids only)
Number of Containers:	3
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

Click this hyperlink while viewing on your computer to access
13 additional NY MANIFEST: record(s) in the EDR Site Report.

AD125 **BYRNE DAIRY** **NY LTANKS** **S105998214**
WSW **KING ST** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.336 mi.
1773 ft. **Site 1 of 3 in cluster AD**

Relative: LTANKS:
Lower

Actual: Name:	BYRNE DAIRY
390 ft. Address:	KING ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0211606 / 2003-07-30
Facility ID:	0211606
Site ID:	109545
Spill Date:	2003-02-22
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	D5
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2003-02-22

BYRNE DAIRY (Continued) **S105998214**

CID:	396
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2003-02-22
Spill Record Last Update:	2003-07-30
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	TIM DEREAMER
Spiller Phone:	(716) 727-4523
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	96112
Latitude:	43.0379819
Longitude:	-76.1531140
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	tank overflow due to having the wrong trank size info.

All Materials:

Site ID:	109545
Operable Unit ID:	862693
Operable Unit:	01
Material ID:	511393
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	5.00
Resource Affected:	Soil
Oxygenate:	Not reported

AD126 **BYRNE DAIRY** **NY LTANKS** **S100128532**
WSW **235 KING STREET** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.336 mi.
1773 ft. **Site 2 of 3 in cluster AD**

Relative:
Lower

Actual:
390 ft.

LTANKS:

Name:	BYRNE DAIRY
Address:	235 KING STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8603904 / 1988-01-15
Facility ID:	8603904
Site ID:	198191
Spill Date:	1986-09-16
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Cleanup Ceased:	1988-01-15

BYRNE DAIRY (Continued) **S100128532**

SWIS:	3415
Investigator:	VOLLMER
Referred To:	Not reported
Reported to Dept:	1986-09-16
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1986-09-17
Spill Record Last Update:	1988-01-15
Spiller Name:	Not reported
Spiller Company:	BYRNE DAIRY
Spiller Address:	235 KING ST.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	164948
Latitude:	43.0381229
Longitude:	-76.1532180
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was JR / / : CLEMETT CO. IS TANK TESTER COMPANY.
Remarks:	TANK TESTED OUT OF TOLERANCE -.657 PER HOUR

All Materials:

Site ID:	198191
Operable Unit ID:	901148
Operable Unit:	01
Material ID:	476717
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

AE127 **MONDO'S AGWAY** **UST FINDER RELEASE** **1029068240**
SSW **1127 SO. SALINA ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.342 mi.
1805 ft. **Site 1 of 4 in cluster AE**

Relative:
Lower

Actual:
390 ft.

UST FINDER RELEASE:

Object ID:	249464
Facility ID:	NY244120
Lust ID:	NY8403634
Name:	MONDO'S AGWAY
Address:	1127 SO. SALINA ST
City,State,Zip:	SYRACUSE, NY 0

MONDO'S AGWAY (Continued) **1029068240**

Address Match Type:	Not reported
Reported Date:	1985/03/25 16:00:00+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1504
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.14947
Y Coord:	43.0361
Latitude:	43.0360999999999
Longitude:	-76.1494699999999

AE128 **MONDO'S** **NY LTANKS** **U003313095**
SSW **1127 SOUTH SALINA ST** **NY UST** **N/A**
1/4-1/2 **SYRACUSE, NY 13202** **NY Spills**
0.342 mi.
1805 ft. **Site 2 of 4 in cluster AE**

Relative:
Lower

Actual:
390 ft.

LTANKS:

Name:	MONDO'S AGWAY
Address:	1127 SO. SALINA ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8403634 / 1991-06-17
Facility ID:	8403634
Site ID:	302125
Spill Date:	1985-03-25
Spill Cause:	Tank Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	C3
Cleanup Ceased:	1991-06-17
SWIS:	3415
Investigator:	GREGG
Referred To:	Not reported
Reported to Dept:	1985-03-25
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Police Department
Last Inspection:	Not reported
Recommended Penalty:	False

MONDO'S (Continued) **U003313095**

Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	1993-11-19
Spiller Name:	Not reported
Spiller Company:	EDWARD MONDO
Spiller Address:	341 SO. COLLINGWOOD AVE.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	244120
Latitude:	43.0361025
Longitude:	-76.1494703
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was TG 06/14/89: CHECKED WELLS WITH J. SEITZ. FREE PRODUCT IN ALL 3 WELLS. 07/10/89: INTERIM ISR GIVEN TO REGIONAL ATTORNEY. MET WITH MR. MONDO AND HE IS HIRING A CONSULTANT TO DO A PHASE I HYDROGEO STUDY. 04/20/91: SITE VISIT TO BE PERFORMED TO CHECK LEVELS IN WELLS AND TO TALK WITH SPILLER. 06/17/91: ALL FREE PRODUCT REMOVED.
Remarks:	LOST 250 GAL. TANK BEING REMOVED FOUND PRODUCT.

All Materials:

Site ID:	302125
Operable Unit ID:	896071
Operable Unit:	01
Material ID:	482430
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	250.00
Units:	G
Recovered:	190.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

UST:

Name:	MONDO'S
Address:	1127 SOUTH SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-042161 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	12/02/2026
UTM X:	406397.85388
UTM Y:	4765415.76441
Site Type:	Retail Gasoline Sales

Affiliation Records:

Site Id:	44246
Affiliation Type:	Mail Contact
Company Name:	MONDOS
Contact Type:	Not reported

MONDO'S (Continued) **U003313095**

Contact Name:	MARK MONDO
Address1:	1127 SOUTH SALINA ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 475-7434
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2010-06-03

Site Id:	44246
Affiliation Type:	Facility Operator
Company Name:	MONDOS
Contact Type:	Not reported
Contact Name:	MARK MONDO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 475-7434
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2016-11-07

Site Id:	44246
Affiliation Type:	Emergency Contact
Company Name:	EDWARD MONDO
Contact Type:	Not reported
Contact Name:	MARK MONDO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(315) 424-8851
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKemp
Date Last Modified:	2006-09-25

Site Id:	44246
Affiliation Type:	Facility Owner
Company Name:	MONDOS AGWAY
Contact Type:	OWNER
Contact Name:	MARK MONDO
Address1:	4901 MACGREGOR LN
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13215

MONDO'S (Continued) **U003313095**

Country Code:	001
Phone:	(315) 424-8851
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2019-07-31

Tank Info:

Tank Number:	001
Tank ID:	126775
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	8000
Install Date:	05/01/1985
Date Tank Closed:	06/14/2007
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	00
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

H05 - Tank Leak Detection - In-Tank System (ATG)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
K01 - Spill Prevention - Catch Basin
I02 - Overfill - High Level Alarm
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
B02 - Tank External Protection - Original Sacrificial Anode
E04 - Piping Secondary Containment - Double walled UG
L08 - Piping Leak Detection - Tank Top Sump
I03 - Overfill - Automatic Shut-Off
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D11 - Pipe Type - Flexible Piping

Tank Number:	002
Tank ID:	126776
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	0
Install Date:	05/01/1985
Date Tank Closed:	06/14/2007
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel

MONDO'S (Continued) **U003313095**

Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 00
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

H05 - Tank Leak Detection - In-Tank System (ATG)
D11 - Pipe Type - Flexible Piping
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
B02 - Tank External Protection - Original Sacrificial Anode
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I03 - Overfill - Automatic Shut-Off
L08 - Piping Leak Detection - Tank Top Sump

Tank Number: 003
Tank ID: 126777
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 8000
Install Date: 05/01/1985
Date Tank Closed: 06/14/2007
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 00
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

H05 - Tank Leak Detection - In-Tank System (ATG)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
K01 - Spill Prevention - Catch Basin
I02 - Overfill - High Level Alarm
J01 - Dispenser - Pressurized Dispenser
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None

MONDO'S (Continued) **U003313095**

B02 - Tank External Protection - Original Sacrificial Anode
I03 - Overfill - Automatic Shut-Off
L08 - Piping Leak Detection - Tank Top Sump
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D11 - Pipe Type - Flexible Piping

Tank Number: 004
Tank ID: 126778
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 0
Install Date: 05/01/1985
Date Tank Closed: 06/14/2007
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 00
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

H05 - Tank Leak Detection - In-Tank System (ATG)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J01 - Dispenser - Pressurized Dispenser
B02 - Tank External Protection - Original Sacrificial Anode
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
L08 - Piping Leak Detection - Tank Top Sump
I03 - Overfill - Automatic Shut-Off
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D11 - Pipe Type - Flexible Piping

Tank Number: 005
Tank ID: 126779
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 500
Install Date: 05/01/1985
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0022
Common Name of Substance: Waste Oil/Used Oil

MONDO'S (Continued) **U003313095**

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

D00 - Pipe Type - No Piping
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
H04 - Tank Leak Detection - Groundwater Well
B07 - Tank External Protection - Retrofitted Sacrificial Anode
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: 006
Tank ID: 221423
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 6000
Install Date: 06/21/2007
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: 0
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

B09 - Tank External Protection - Urethane
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
C02 - Pipe Location - Underground/On-ground
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off
D11 - Pipe Type - Flexible Piping
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 007
Tank ID: 221424
Tank Status: In Service

MONDO'S (Continued) **U003313095**

Material Name:	In Service
Capacity Gallons:	6000
Install Date:	06/21/2007
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	0
Material Code:	2712
Common Name of Substance:	Gasoline/Ethanol
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
K01 - Spill Prevention - Catch Basin
B09 - Tank External Protection - Urethane
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
D11 - Pipe Type - Flexible Piping
G04 - Tank Secondary Containment - Double-Walled (Underground)
C02 - Pipe Location - Underground/On-ground
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off

Tank Number:	008
Tank ID:	221425
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	4000
Install Date:	06/21/2007
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	0
Material Code:	2712
Common Name of Substance:	Gasoline/Ethanol
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
B09 - Tank External Protection - Urethane

MONDO'S (Continued) **U003313095**

L07 - Piping Leak Detection - Pressurized Piping Leak Detector
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off
C02 - Pipe Location - Underground/On-ground
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
D11 - Pipe Type - Flexible Piping
G04 - Tank Secondary Containment - Double-Walled (Underground)

SPILLS:

Name:	GAS STATION
Address:	1127 SOUTH SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1808400 / 2018-11-08
Facility ID:	1808400
Facility Type:	ER
DER Facility ID:	43615
Site ID:	579205
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	3415
Spill Date:	2018-11-07
Investigator:	CFNORRIS
Referred To:	Not reported
Reported to Dept:	2018-11-07
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2018-11-07
Spill Record Last Update:	2019-05-28
Spiller Name:	Not reported
Spiller Company:	MONDO'S
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	PATRICK VROOMAN
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	The stp sump for tank 7 failed visual inspection for a torn boot on sump product line entry boo. Dispenser # 3 and 4 failed visual inspection due to there is no secondary boot on product line.
Remarks:	stp sump failure

All Materials:

Site ID:	579205
Operable Unit ID:	1326930
Operable Unit:	01
Material ID:	2335764

MONDO'S (Continued) **U003313095**

Material Code:	9999
Material Name:	other - stp sump failure
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Site ID:	579205
Operable Unit ID:	1326930
Operable Unit:	01
Material ID:	2345963
Material Code:	2712
Material Name:	gasoline/ethanol
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	MONDOS SERVICE CENTER
Address:	1127 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0412947 / 2005-03-14
Facility ID:	0412947
Facility Type:	ER
DER Facility ID:	273915
Site ID:	338576
DEC Region:	7
Spill Cause:	Human Error
Spill Class:	C5
SWIS:	3400
Spill Date:	2005-03-11
Investigator:	MENASH
Referred To:	Not reported
Reported to Dept:	2005-03-11
CID:	444
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2005-03-11
Spill Record Last Update:	2005-03-14
Spiller Name:	MARK
Spiller Company:	MONDOS SERVICE CENTER
Spiller Address:	1127 SOUTH SALINA STREET
Spiller Company:	001

MONDO'S (Continued) **U003313095**

Contact Name: MARK
Latitude: 43.0361050
Longitude: -76.1494630
DEC Memo: Not reported
Remarks: A PINT SPILLED WHEN HE WAS CLEANING AND HE ACCIDENTALLY KICKE DTHE BUCKET ALL CLEANED UP

All Materials:
Site ID: 338576
Operable Unit ID: 1100512
Operable Unit: 01
Material ID: 580805
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Resource Affected: Soil
Oxygenate: Not reported

---

129 NE 1/4-1/2 0.348 mi. 1839 ft. **HUTCHINGS PSYCH CENTER** **NY LTANKS S108956928**
620 MADISON STREET **NY Spills N/A**
SYRACUSE, NY 13210

Relative: Higher
Actual: 401 ft.

LTANKS:
Name: HUTCHINGS PSYCH CENTER
Address: 620 MADISON ST
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 0211660 / 2004-11-26
Facility ID: 0211660
Site ID: 187125
Spill Date: 2003-02-24
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: C3
Cleanup Ceased: 2004-11-15
SWIS: 3415
Investigator: CFMANNES
Referred To: Not reported
Reported to Dept: 2003-02-24
CID: 396
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: 2004-10-04
Recommended Penalty: False
Meets Standard: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 2003-02-24
Spill Record Last Update: 2005-01-03
Spiller Name: Not reported
Spiller Company: SAME
Spiller Address: Not reported

HUTCHINGS PSYCH CENTER (Continued) **S108956928**

Spiller County:	999
Spiller Contact:	TRACIE SHIFFLET
Spiller Phone:	(315) 473-4908
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	156365
Latitude:	43.0453880
Longitude:	-76.1412335
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	gross failure. believe that the leak is in the upper part of the tank and that there is no product leak.

All TTF:

Facility ID:	0211660
Spill Number:	0211660
Spill Tank Test:	1528042
Site ID:	187125
Tank Number:	10
Tank Size:	10000
Material:	0001
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	187125
Operable Unit ID:	862725
Operable Unit:	01
Material ID:	511448
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	False

SPILLS:

Name:	HUTCHINGS PSYCH CENTER
Address:	620 MADISON STREET
City,State,Zip:	SYRACUSE, NY 13210
Spill Number/Closed Date:	0807781 / 2008-12-02
Facility ID:	0807781
Facility Type:	ER
DER Facility ID:	354391
Site ID:	405145
DEC Region:	7

HUTCHINGS PSYCH CENTER (Continued) **S108956928**

Spill Cause:	Other
Spill Class:	C4
SWIS:	3415
Spill Date:	2008-10-09
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2008-10-09
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Non Major Facility > 1,100 gal
Spill Notifier:	Local Agency
Cleanup Ceased:	2008-12-02
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2008-10-09
Spill Record Last Update:	2017-06-12
Spiller Name:	Not reported
Spiller Company:	HUTCHINGS PSYCH CENTER
Spiller Address:	20 MADISON STREET
Spiller Company:	999
Contact Name:	TRACI SHIFFLET BUILDING #1
Latitude:	43.0453178
Longitude:	-76.1379074
DEC Memo:	Closed as NFA not meeting stds due to SVOC contamination that could not be remediated. See report in eDox. 6/12/2017 - Additional soil removal report received and filed. KCKemp
Remarks:	Not reported

All Materials:

Site ID:	405145
Operable Unit ID:	1161780
Operable Unit:	01
Material ID:	2152983
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	HUTCHINGS PSYCH CENTER
Address:	620 MADISON ST
City,State,Zip:	SYRACUSE, NY 13210
Spill Number/Closed Date:	0807277 / 2008-11-13
Facility ID:	0807277
Facility Type:	ER
DER Facility ID:	353576
Site ID:	404617
DEC Region:	7
Spill Cause:	Other

HUTCHINGS PSYCH CENTER (Continued) **S108956928**

Spill Class:	C4
SWIS:	3415
Spill Date:	2008-09-29
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2008-09-29
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Non Major Facility > 1,100 gal
Spill Notifier:	Other
Cleanup Ceased:	2008-11-13
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2008-09-29
Spill Record Last Update:	2008-11-13
Spiller Name:	TRACIE SHIFFLET
Spiller Company:	HUTCHINGS
Spiller Address:	620 MADISON ST
Spiller Company:	999
Contact Name:	TRACIE SHIFFLET
Latitude:	43.0453178
Longitude:	-76.1379074
DEC Memo:	Minor SVOC exceedences from tank removal per eDoc'd results.KCKemp
Remarks:	Soil test results came back showing oil contamination. No clean up is scheduled.

All Materials:

Site ID:	404617
Operable Unit ID:	1161264
Operable Unit:	01
Material ID:	2152459
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	HUTCHING PSYCH CTR TANK 007
Address:	620 MADISON ST
City,State,Zip:	SYRACUSE, NY 13210
Spill Number/Closed Date:	0807003 / 2008-11-13
Facility ID:	0807003
Facility Type:	ER
DER Facility ID:	353576
Site ID:	404315
DEC Region:	7
Spill Cause:	Other
Spill Class:	C4
SWIS:	3415
Spill Date:	2008-09-22

HUTCHINGS PSYCH CENTER (Continued) **S108956928**

Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2008-09-22
CID:	Not reported
Water Affected:	NONE
Spill Source:	Non Major Facility > 1,100 gal
Spill Notifier:	Other
Cleanup Ceased:	2008-11-13
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2008-09-22
Spill Record Last Update:	2008-11-13
Spiller Name:	RICK HOWARD
Spiller Company:	NYS OFFICE OF MENTAL HEALTH
Spiller Address:	44 HOLLAND AVE
Spiller Company:	001
Contact Name:	RICK HOWARD
Latitude:	43.0453178
Longitude:	-76.1379074
DEC Memo:	Analytical results indicate soil contamination - tight site, no addl excavation required. Closed NFA not meeting stds. Spoils to stay on site and used as fill.
Remarks:	Analytical results indicate soil contamination

All Materials:

Site ID:	404315
Operable Unit ID:	1160980
Operable Unit:	01
Material ID:	2152169
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	HUTCHINGS
Address:	620 MADISON ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9312426 / 1994-01-22
Facility ID:	9312426
Facility Type:	ER
DER Facility ID:	156365
Site ID:	297513
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	1994-01-22
Investigator:	GREGG
Referred To:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **S108956928**

Reported to Dept:	1994-01-22
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	1994-01-22
Cleanup Meets Std:	True
Last Inspection:	1994-01-22
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	GRIFFITH OIL
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0453880
Longitude:	-76.1412335
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was TG
Remarks:	AIR POCKET DEVELOPED WHILE FILLING TANK. EPS HIRED TO CLEAN UP.

All Materials:

Site ID:	297513
Operable Unit ID:	994439
Operable Unit:	01
Material ID:	387855
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	HUTCHING PSYC-BUILDING 10
Address:	620 MADISON AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0709106 / 2008-02-06
Facility ID:	0709106
Facility Type:	ER
DER Facility ID:	339717
Site ID:	390129
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2007-11-20
Investigator:	hdwarner
Referred To:	Not reported
Reported to Dept:	2007-11-21
CID:	408
Water Affected:	Not reported
Spill Source:	Commercial/Industrial

HUTCHINGS PSYCH CENTER (Continued) **S108956928**

Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	2007-11-20
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2007-11-21
Spill Record Last Update:	2008-05-27
Spiller Name:	MIKE HOLIDAY
Spiller Company:	HUTCHING PSYC-BUILDING 10
Spiller Address:	620 MADISON AVE
Spiller Company:	001
Contact Name:	ANDREW AMELO
Latitude:	43.0453178
Longitude:	-76.1379074
DEC Memo:	Not reported
Remarks:	HAS SPOKEN TO HARRY WARRNER FROM REGION 7 HAD STOPPED BY AND SEEN THE EXCAVATION AND DEEMED IT VISUALLY CLEAN; OIL SEPERATOR IS THE TYPE OF TANK;' THE SEAL AROUND THE TOP OF THE CONCRETE TANK APPEARS TO HAVE FAILED;

All TTF:

Facility ID:	0709106
Spill Number:	0709106
Spill Tank Test:	2365808
Site ID:	390129
Tank Number:	Not reported
Tank Size:	750
Material:	0066
EPA UST:	Not reported
UST:	True
Cause:	03
Source:	01
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Watchdog
Last Modified Date:	Not reported

All Materials:

Site ID:	390129
Operable Unit ID:	1147242
Operable Unit:	01
Material ID:	2137643
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **S108956928**

Name:	HUTCHINGS PSYCH CENTER
Address:	620 MADISON ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0208287 / 2002-11-12
Facility ID:	0208287
Facility Type:	ER
DER Facility ID:	156365
Site ID:	187124
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2002-11-11
Investigator:	CXROSSI
Referred To:	Not reported
Reported to Dept:	2002-11-11
CID:	281
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2002-11-11
Spill Record Last Update:	2002-11-12
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	RICK HOWARD
Latitude:	43.0453880
Longitude:	-76.1412335
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CTR SUMP DISCHARGE CONNECTS TO SANITARY SEWER ACCORDING TO RICK HOWARD
Remarks:	HYDRAULIC FAILURE AT ABOVE LOCATION ON ELEVATOR. MATERIAL MAY HAVE DRAINED INTO PUMP PIT WHICH FLOWS INTO STORM SEWER AT ABOVE LOCATION. REPAIR COMPANY ON SCENE. CALLER REQUESTS CALLBACK AND CAN BE REACHED ON CELL # 315-243-5852.

All Materials:

Site ID:	187124
Operable Unit ID:	859770
Operable Unit:	01
Material ID:	515296
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	5.00
Resource Affected:	Sewer
Oxygenate:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **S108956928**

Name:	BUILDING 12
Address:	620 MADISON ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9814456 / 2002-08-06
Facility ID:	9814456
Facility Type:	ER
DER Facility ID:	156365
Site ID:	187126
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	1999-02-27
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1999-03-03
CID:	382
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1999-03-03
Spill Record Last Update:	2002-08-06
Spiller Name:	TOM ZIENTEK
Spiller Company:	HUTCHINGS PSYCHIATRIC
Spiller Address:	620 MADISON ST
Spiller Company:	001
Contact Name:	TOM ZIENTEK
Latitude:	43.0453880
Longitude:	-76.1412335
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM SPOKE WITH TOM ZIENTEK: RECOVERED 40 GAL, WIPED DOWN SUMP PIT, DIPOSED OF OIL BY MEANS OF COLLECTION TANK THAT IS PUMPED AND DISPOSED BY CONTRACTORS ON A PERIODIC BASIS.
Remarks:	A BROKEN FUEL LINE TO A BOILER CAUSED THE SPILL. SPILL WAS ON BASEMENT FLOORING AND WAS CLEANED UP.

All Materials:

Site ID:	187126
Operable Unit ID:	1072037
Operable Unit:	01
Material ID:	311144
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	40.00
Units:	G
Recovered:	40.00
Resource Affected:	Soil
Oxygenate:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **S108956928**

Name:	HUTCHINGS PC
Address:	620 MADISON ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0908714 / 2009-11-04
Facility ID:	0908714
Facility Type:	ER
DER Facility ID:	156365
Site ID:	421364
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2009-09-29
Investigator:	hdwarner
Referred To:	Not reported
Reported to Dept:	2009-11-03
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-11-03
Spill Record Last Update:	2009-11-04
Spiller Name:	Not reported
Spiller Company:	HUTCHINGS PC
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	RICH HOWARD
Latitude:	43.0453178
Longitude:	-76.1379074
DEC Memo:	Not reported
Remarks:	4000gal ust removed/Atlantic Testing was on site for tank pull and soil testing.Soil test show soil contamination. Harry Warner has been advised

All Materials:

Site ID:	421364
Operable Unit ID:	1177255
Operable Unit:	01
Material ID:	2170023
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

Site ID:	421364
Operable Unit ID:	1177255
Operable Unit:	01

HUTCHINGS PSYCH CENTER (Continued) **S108956928**

Material ID:	2170019
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

---

130 SW 1/4-1/2 0.349 mi. 1841 ft.

JMA CAMPUS PLAN
623 ONEIDA STREET
SYRACUSE, NY 13202

NY BROWNFIELDS **S132119353**
N/A

Relative: Lower

Actual: 390 ft.

BROWNFIELDS:

Name:	JMA CAMPUS PLAN
Address:	623 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	667687
Acres:	6.960
HW Code:	C734166
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	05/15/2024
Record Updated Date:	06/11/2024
Update By:	GWPRISCO
Site Description:	"Location: The JMA Campus Plan (Site) is a 6.96-acre property located in an urban area at 623 Oneida Street, in the City of Syracuse, Onondaga County, New York. The Site limits are bounded by West Taylor Street to the north, the former South Clinton Street to the east, Tallman Street to the south, and Oneida Street to the west. The Site is comprised of what was once 24 separate, contiguous parcels, that were recently re-zoned to form a single parcel. Site Features: The Site features include gravel or paved parking lots, small green space areas, and three vacant buildings. Current Zoning and Land Use: The Site is zoned industrial and consists of the following features: Gravel or paved parking lots, Limited green space areas, and Three vacant buildings; Neighboring properties include various commercial and industrial facilities in all directions, with the closest residences located approximately 0.1-miles to the west. Onondaga Creek, a tributary to Onondaga Lake, is located approximately 580-feet to the west of the Site. The site is depicted as Census Block 360670042002 which is classified as Enzone Type AB and is Listed as a disadvantaged community. The Site entire 6.96-acre project Site is within this boundary. Past Use of the Site: The Site has historically primarily been utilized by industrial facilities as far back as the early 1900 s with various occupants including: Syracuse Stamp, a manufacturer of high-quality garage door hardware, gate faucets and inked ribbon spools since 1908. This property is a potential source of contamination given the use of heavy machinery and metals. Underground storage tanks were also previously located on the site. Tompkins USA a manufacturer of knitting machinery and equipment for the textile industry located in Syracuse since 1914.

JMA CAMPUS PLAN (Continued) **S132119353**

	This property is a potential source of contamination given the use of heavy machinery for textiles. Sources of heat likely also included coal burning equipment and fuel oil from bulk storage tanks. Horizon Transport, a junk yard and storage facility. This property is a potential source of contamination given the junk yard/scrap yard uses for many years, the disarray of the facility, and multiple leaking vehicles and drums observed on the property. Coyne Textile Fleet Truck Maintenance Facility. This property is a potential source of chlorinated VOC contamination given the history as a Coyne Textile property. Trucks from the Coyne fleet were often taken to this property for repair, washing, etc. Evidence of contamination was observed during the previous environmental investigations. Site Geology and Hydrogeology: According to the USDA Web Soil Survey for Onondaga County, soils beneath the Site consist of Urban Land. Review of the USGS Geologic Map of New York indicates the bedrock geology of the area consists of the Syracuse Formation of the Upper Silurian age. Generally, the bedrock consists of dolostone and shale. Regional groundwater flow direction, inferred from topographic mapping of the area and historical investigations, is generally west towards Onondaga Creek. "
Env Problem:	"Information submitted with the BCP application regarding the environmental condition at the site are currently under review and will be revised as additional information becomes available."
Health Problem:	"Information submitted with the BCP application regarding the conditions at the site are currently under review and will be revised as additional information becomes available."
Dump:	Not reported
Structure:	Not reported
Lagoon:	Not reported
Landfill:	Not reported
Pond:	Not reported
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	Not reported
Record Upd:	Not reported
Updated By:	Not reported
Own Op:	6
Sub Type:	P03
Owner Name:	Dino Peios
Owner Company:	JMA Tech Properties, LLC
Owner Address:	PO Box 580
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America
Own Op:	4
Sub Type:	E
Owner Name:	Dino Peios
Owner Company:	JMA Tech Properties, LLC
Owner Address:	PO Box 580
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America
Own Op:	1
Sub Type:	E
Owner Name:	Dino Peios

JMA CAMPUS PLAN (Continued) **S132119353**

Owner Company:	JMA Tech Properties, LLC
Owner Address:	PO Box 580
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	C01
Owner Name:	Not reported
Owner Company:	Onondaga Public Library Central Branch
Owner Address:	447 South Salina St
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	Not reported
Cross Ref Type Code:	Not reported
Cross Ref Type:	Not reported
Record Added Date:	Not reported
Record Updated:	Not reported
Updated By:	Not reported

AE131 **MONDO'S SERVICE STATION** **NY LTANKS** **S108639805**
SSW **1133 SOUTH SALINA** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.349 mi.
1843 ft. **Site 3 of 4 in cluster AE**

Relative: **Lower**
Actual: **390 ft.**

LTANKS:

Name:	MONDO'S SERVICE STATION
Address:	1133 SOUTH SALINA
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0703031 / 2007-10-04
Facility ID:	0703031
Site ID:	382878
Spill Date:	2007-06-13
Spill Cause:	Tank Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	D3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	RJBRAZEL
Referred To:	Not reported
Reported to Dept:	2007-06-13
CID:	444
Water Affected:	SHEEN
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	2007-06-13
Spill Record Last Update:	2007-10-04
Spiller Name:	JOHN LAVALLEY
Spiller Company:	MONDO'S SERVICE STATION

MONDO'S SERVICE STATION (Continued) **S108639805**

Spiller Address:	1133 SOUTH SALINA
Spiller County:	999
Spiller Contact:	JOHN LAVALLEY
Spiller Phone:	(315) 573-2577
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	332326
Latitude:	43.0360231
Longitude:	-76.1494610
DEC Memo:	Not reported
Remarks:	FOUND SHEEN AND ODOR WHILE REMOVING TANKS:

All Materials:

Site ID:	382878
Operable Unit ID:	1140258
Operable Unit:	01
Material ID:	2130319
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

AE132 **MONDO'S SERVICE STATION** **UST FINDER RELEASE** **1029074539**
SSW **1133 SOUTH SALINA** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.349 mi.
1843 ft. **Site 4 of 4 in cluster AE**

Relative: **Lower**
Actual: **390 ft.**

UST FINDER RELEASE:

Object ID:	249465
Facility ID:	NY332326
Lust ID:	NY703031
Name:	MONDO'S SERVICE STATION
Address:	1133 SOUTH SALINA
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	2007/06/13 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1519
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported

MONDO'S SERVICE STATION (Continued) **1029074539**

Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.14946
Y Coord:	43.0360200000001
Latitude:	43.03602
Longitude:	-76.14946

133
ENE
1/4-1/2
0.353 mi.
1863 ft.

Relative:
Higher

Actual:
443 ft.

SUNY HEALTH SCIENCE CENTER
750 EAST ADAMS STREET
SYRACUSE, NY 13210

NY LTANKS **U003077876**
NY CBS **N/A**
NY AST
NY CBS AST
NY Spills
NY MANIFEST

LTANKS:

Name:	SUNY UPSTATE
Address:	750 EAST ADAMS ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1406531 / 2015-07-22
Facility ID:	1406531
Site ID:	500005
Spill Date:	2014-09-19
Spill Cause:	Tank Test Failure
Spill Source:	Non Major Facility > 1,100 gal
Spill Class:	D4
Cleanup Ceased:	2015-07-22
SWIS:	3415
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2014-09-19
CID:	Not reported
Water Affected:	NONE
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2014-09-19
Spill Record Last Update:	2015-07-22
Spiller Name:	ROB ANDRUS
Spiller Company:	SUNY UPSTATE
Spiller Address:	750 EAST ADAMS ST
Spiller County:	999
Spiller Contact:	ROB ANDRUS
Spiller Phone:	(315) 464-4019
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	455022
Latitude:	43.0426300
Longitude:	-76.1405422

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

DEC Memo: 4/15/2015 - PBS #7-129410. Vent repaired temporarily. Spill to remain open until tank tightness tested. KCKemp 7/22/2015 - Vent repaired and tank tested tight. Spill closed. KCKemp

Remarks: VENT PIPE CRUSHED DURING CONSTRUCTION. PRIMARY DOES NOT HOLD PRESSURE. NO LEAK SUSPECTED DUE TO RECENT CONSTRUCTION IN AREA THAT MAY HAVE CRUSHED VENT PIPE.

All Materials:

Site ID:	500005
Operable Unit ID:	1249408
Operable Unit:	01
Material ID:	2250990
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

CBS:

Name:	SUNY HEALTH SCIENCE CENTER
Address:	750 EAST ADAMS STREET
City,State,Zip:	SYRACUSE, NY 13210
CBS Number:	7-000251
Program Type:	CBS
Facility Status:	Unregulated/Closed
Expiration Date:	Not reported
Dec Region:	7
UTMX:	407100.14033
UTMY:	4766179.96721

AST:

Name:	SUNY HEALTH SCIENCE CENTER
Address:	750 EAST ADAMS STREET
City,State,Zip:	SYRACUSE, NY 13210
Region:	STATE
DEC Region:	7
Site Status:	Unregulated/Closed
Facility Id:	7-000251
Program Type:	CBS
UTM X:	407100.14033
UTM Y:	4766179.96721
Expiration Date:	N/A
Site Type:	School

Tank Info:

Tank Number:	H100
Tank Id:	190756
Tank Location:	Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.
Tank Type:	Plastic
Tank Status:	Closed - In Place

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Pipe Model:	Not reported
Install Date:	10/01/1993
Capacity Gallons:	1500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

CBS AST:

CBS Number:	7-000251
ICS Number:	Not reported
PBS Number:	7-129410
MOSF Number:	Not reported
SPDES Number:	Not reported
Facility Status:	IN SERVICE
Facility Type:	G
Telephone:	(315) 464-4230
Facility Town:	SYRACUSE (C)
Region:	STATE
Expiration Date:	10/07/1999
Total Capacity of All Active Tanks(gal):	0
Operator:	PHYSICAL PLANT
Emergency Contact:	PHYSICAL PLANT
Emergency Phone:	(315) 464-4230
Owner Name:	SUNY HEALTH SCIENCE CENTER
Owner Address:	750 EAST ADAMS STREET
Owner City,St,Zip:	SYRACUSE, NY 13210
Owner Telephone:	(315) 464-4230
Owner Type:	State Government
Owner Sub Type:	State University of New York
Mail Name:	SUNY HEALTH SCIENCE CENTER
Mail Contact Addr:	750 EAST ADAMS STREET
Mail Contact Addr2:	Not reported
Mail Contact Contact:	GARY W. KITTELL
Mail Contact City,St,Zip:	SYRACUSE, NY 13210
Mail Phone:	(315) 464-4448

Tank Id:	H100
CAS Number:	1310732
Federal ID:	Not reported
Tank Status:	0
Install Date:	10/93
Tank Closed:	00/00
Capacity (Gal):	1500
Chemical:	Sodium hydroxide
Tank Location:	Indoors, Aboveground
Tank Type:	Fiberglass reinforced plastic [FRP]
Total Tanks:	0
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	10/04/1993
Certified Date:	08/07/1997

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None
Pipe Location:	Aboveground
Pipe Type:	Wrapped Steel
Pipe Internal:	None
Pipe External:	None
Pipe Flag:	None
Leak Detection:	None
Overfill Protection:	Product Level Gauge
Haz Percent:	50
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	/ /
Is It There:	False
Delinquent:	False
Date Expired:	10/07/95
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True
Pre-Printed Renewal App Last Printed:	07/06/1999

SPILLS:

Name:	SUNY
Address:	750 EAST ADAMS
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9201660 / 1992-06-01
Facility ID:	9201660
Facility Type:	ER
DER Facility ID:	125125
Site ID:	323015
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	1992-05-11
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	1992-05-11
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	1992-05-11
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1992-06-01
Spill Record Last Update:	1993-03-27
Spiller Name:	Not reported
Spiller Company:	SUNY HEALTH SCIENCE

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0426655
Longitude:	-76.1406306
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was HW 06/01/92: SMALL QUANTITY OF TRANSFORMER OIL SPILLED ONTO CONCRETE PAD. MATERIAL CLEANED UP BY SUNY.
Remarks:	TRANSFORMER LEAKING AT PIPING ONTO CONCRETE PAD. OIL CONTAINS LESS THAN 50 PPM PCB.

All Materials:

Site ID:	323015
Operable Unit ID:	965748
Operable Unit:	01
Material ID:	412952
Material Code:	0016A
Material Name:	non PCB oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3.00
Units:	G
Recovered:	3.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	UPSTATE MEDICAL UNIVERSITY
Address:	750 EAST ADAMS
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1107526 / 2011-09-15
Facility ID:	1107526
Facility Type:	ER
DER Facility ID:	125125
Site ID:	455228
DEC Region:	7
Spill Cause:	Other
Spill Class:	D4
SWIS:	3415
Spill Date:	2011-09-14
Investigator:	DJLASALL
Referred To:	Not reported
Reported to Dept:	2011-09-14
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2011-09-14
Spill Record Last Update:	2011-09-15
Spiller Name:	ROBERT NOBLE
Spiller Company:	LECHASE CONSTRUCTION

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Spiller Address:	750 EAST ADAMS
Spiller Company:	999
Contact Name:	ROBERT NOBLE
Latitude:	43.0426300
Longitude:	-76.1405422
DEC Memo:	spoke with Mr. Noble. source of spill was old oil lantern buried in ground. Soil and lantern removed to 5 gallon pail. Clean Harbors to handle disposal. NFA
Remarks:	FOUND SOME TYPE OF GREEN OOZE SEEPING OUT WHILE DIGGING TO PUT IN A NEW WATER LINE. UNKNOWN WHAT THE MTERIAL IS OR HOW MUCH IS THERE.

All Materials:

Site ID:	455228
Operable Unit ID:	1205382
Operable Unit:	01
Material ID:	2202228
Material Code:	0012A
Material Name:	kerosene
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	SUNY MED UNIVERSITY
Address:	750 EAST ADAMS
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0209530 / 2003-06-01
Facility ID:	0209530
Facility Type:	ER
DER Facility ID:	125125
Site ID:	146952
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	3415
Spill Date:	2002-12-16
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2002-12-16
CID:	252
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	2002-12-17
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2002-12-16
Spill Record Last Update:	2003-11-20
Spiller Name:	ROBERT ANDRUS
Spiller Company:	SUNY MED UNIVERSITY
Spiller Address:	750 EAST ADAMS

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Spiller Company:	001
Contact Name:	ROBERT ANDRUS
Latitude:	43.0426655
Longitude:	-76.1406306
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	SPILL IS UNDER INVESTIGATION AT THIS TIME. ARRANGEMENTS FOR CLEANUP TO BE MADE.

All Materials:

Site ID:	146952
Operable Unit ID:	860817
Operable Unit:	01
Material ID:	512951
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	SUNY UPSTATE MEDICAL
Address:	750 EAST ADAMS
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1004281 / 2010-08-05
Facility ID:	1004281
Facility Type:	ER
DER Facility ID:	125125
Site ID:	437549
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D3
SWIS:	3415
Spill Date:	2010-07-16
Investigator:	cxrossi
Referred To:	Not reported
Reported to Dept:	2010-07-16
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2010-07-16
Spill Record Last Update:	2010-08-05
Spiller Name:	CLAUDE THAUVETTE
Spiller Company:	SUNY UPSTATE MEDICAL
Spiller Address:	750 EAST ADAMS
Spiller Company:	999
Contact Name:	CLAUDE THAUVETTE
Latitude:	43.0426300

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Longitude:	-76.1405422
DEC Memo:	Small drip from return line of generator. Fitting is not working properly and at time of report contractor is changing out equiptment to stop release. Contaminated soil has been removed and staged on poly and covered. More soil will be removed.
Remarks:	clean up underway

All Materials:

Site ID:	437549
Operable Unit ID:	1188222
Operable Unit:	01
Material ID:	2183136
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	4.00
Units:	G
Recovered:	4.00
Resource Affected:	Soil
Oxygenate:	Not reported

NY MANIFEST:

EPA ID:	NYD063053656
Country:	USA
Name:	SUNY HEALTH SCIENCE CENTER
Address:	750 EAST ADAMS STREET
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13210-0000
Zip 4:	Not reported
Location Address 1:	750 E ADAMS ST
Location Address 2:	302 CAMPUS ACTIVITIES BLDG
Location City,State,Zip:	SYRACUSE, NY 13210
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	SUNY HEALTH SCIENCE CENTER
Mailing Contact:	ENVIRON HEALTH & SAFETY
Mailing Address 1:	750 E ADAMS ST
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13210
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154644019

Manifest Data:

Document ID:	NYB2182635
Manifest Status:	Not reported
Trans1 State ID:	LLNJ-0001
Year:	1990
Trans2 State ID:	Not reported
Generator Ship Date:	03/29/1990

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Trans1 Recv Date:	03/29/1990
Trans2 Recv Date:	03/30/1990
TSD Site Recv Date:	04/02/1990
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD041767765
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	FLD980711071
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	01400
Units:	Pounds
Number of Containers:	007
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYC7142433
Manifest Status:	Not reported
Trans1 State ID:	MU2534
Year:	2003
Trans2 State ID:	Not reported
Generator Ship Date:	08/15/2003
Trans1 Recv Date:	08/15/2003
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/15/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	TXR000050930

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00010
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYC7142635
Manifest Status:	Not reported
Trans1 State ID:	NY64167JC
Year:	2003
Trans2 State ID:	Not reported
Generator Ship Date:	09/15/2003
Trans1 Recv Date:	09/15/2003
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/16/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	TXR000050930
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00006
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	2-PROPYN-1-OL (OR) PROPARGYL ALCOHOL
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00040
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	ACETYL CHLORIDE (C,R,T)
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Quantity:	00040
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	IGNITABLE WASTE
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	2,4-DINITROPHENOL (OR) PHENOL, 2,4-DINITRO-
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00040
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	IGNITABLE WASTE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	IGNITABLE WASTE
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	IGNITABLE WASTE
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	IGNITABLE WASTE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	IGNITABLE WASTE
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	OSMIUM OXIDE OSO4, (T-4)- (OR) OSMIUM TETROXIDE
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00012

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Units: Pounds
Number of Containers: 001
Container Type: Fiberboard or plastic drums, barrels, kegs
Handling Method: Burn
Specific Gravity: 01.00

Document ID: ILA7730584
Manifest Status: Not reported
Trans1 State ID: 3890
Year: 1999
Trans2 State ID: 1513
Generator Ship Date: 04/09/1999
Trans1 Recv Date: 04/09/1999
Trans2 Recv Date: 04/15/1999
TSD Site Recv Date: 04/22/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD063053656
Trans1 EPA ID: NJD080631369
Trans2 EPA ID: MOD095038998
TSDF ID 1: ILD098642424
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: CYANOGEN BROMIDE (CN)BR
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00005
Units: Pounds
Number of Containers: 001
Container Type: Fiberboard or plastic drums, barrels, kegs
Handling Method: Burn
Specific Gravity: 01.00
Waste Code 7: SODIUM CYANIDE (OR) SODIUM CYANIDE NA(CN)
Waste Code 8: Not reported
Waste Code: Not reported
Waste Code 10: Not reported
Waste Code 11: Not reported
Quantity: 00010
Units: Pounds
Number of Containers: 001
Container Type: Fiberboard or plastic drums, barrels, kegs
Handling Method: Burn
Specific Gravity: 01.00

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Waste Code 12:	2-PROPENAL (OR) ACROLEIN
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	CORROSIVE WASTE
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	CORROSIVE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	IGNITABLE WASTE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	IGNITABLE WASTE
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	REACTIVE WASTE
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	DIMETHYL SULFATE (OR) SULFURIC ACID, DIMETHYL ESTER
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	BENZENE, (CHLOROMETHYL)- (OR) BENZYL CHLORIDE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00040
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	2-PROPENAMIDE (OR) ACRYLAMIDE
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00200
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	PHENOL
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00400
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	SELENIOUS ACID (OR) SELENIUM DIOXIDE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	2-PROPENAMIDE (OR) ACRYLAMIDE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	SILVER CYANIDE (OR) SILVER CYANIDE AG(CN)
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00005

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	MERCURY
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

SUNY HEALTH SCIENCE CENTER (Continued) **U003077876**

Waste Code 7:	CORROSIVE WASTE
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	CORROSIVE WASTE
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00050
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	REACTIVE WASTE
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Click this hyperlink while viewing on your computer to access
1478 additional NY MANIFEST: record(s) in the EDR Site Report.

AD134 **ATLAS SERVICES** **NY LTANKS** **S100129276**
WSW **TAYLOR ST; KING ST** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.363 mi.
1915 ft. **Site 3 of 3 in cluster AD**

Relative:
Lower

Actual:
390 ft.

LTANKS:

Name:	ATLAS SERVICES
Address:	TAYLOR ST; KING ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8707432 / 1988-01-05
Facility ID:	8707432
Site ID:	243223
Spill Date:	1987-11-25
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	Not reported
Cleanup Ceased:	1988-01-05
SWIS:	3415
Investigator:	AJMARSCH

ATLAS SERVICES (Continued) **S100129276**

Referred To:	Not reported
Reported to Dept:	1987-11-30
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1987-12-04
Spill Record Last Update:	1995-06-02
Spiller Name:	Not reported
Spiller Company:	ATLAS SERVICES
Spiller Address:	KING STREET
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	199799
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was JM / / : 12/02/87 RETESTED AND FAILED AT .676 GPH. TANK HAS BEEN PUMPED OUT. WILL REMOVE TANK AS SOON AS POSSIBLE.
Remarks:	4,000 GAL. TANK FAILURE RATE .111. WILL ISOLATE AND RETEST.

All Materials:

Site ID:	243223
Operable Unit ID:	913121
Operable Unit:	01
Material ID:	466382
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

AF135 **HUTCHINGS** **UST FINDER RELEASE** **1029062132**
NE **500 CEDAR ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.367 mi.
1938 ft. **Site 1 of 2 in cluster AF**

Relative:
Higher

Actual:
400 ft.

UST FINDER RELEASE:

Object ID:	249543
Facility ID:	NY169331
Lust ID:	NY8710954
Name:	HUTCHINGS
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported

HUTCHINGS (Continued) **1029062132**

Reported Date:	1988/03/31 16:00:00+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1623
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.14208
Y Coord:	43.04618
Latitude:	43.04618
Longitude:	-76.14208

AF136 **HUTCHINGS PSYCHIATRIC CTR** **NY LTANKS** **S103558239**
NE **BLDG 11** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.373 mi.
1971 ft. **Site 2 of 2 in cluster AF**

Relative:
Higher

Actual:
400 ft.

LTANKS:

Name:	HUTCHINGS PSYCHIATRIC CTR
Address:	BLDG 11
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9809684 / 2003-10-31
Facility ID:	9809684
Site ID:	121287
Spill Date:	1998-11-02
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1998-11-02
CID:	365
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False

HUTCHINGS PSYCHIATRIC CTR (Continued) **S103558239**

UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1998-11-02
Spill Record Last Update:	2003-11-20
Spiller Name:	Not reported
Spiller Company:	HUTCHINGS PSYCHIATRIC CTR
Spiller Address:	BLDG 11
Spiller County:	001
Spiller Contact:	OGS - MIKE HOLIDAY
Spiller Phone:	(315) 430-8513
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	105279
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	POSS OVERFILLED CAUSED SPILL THAT WAS NOTICED DURING AN UNDERGROUND TANK REMOVAL - THEY WILL EXCAVATE CONTAMINATED SOIL, INVESTIGATE & TAKE SAMPLES

AG137 **H.S.M.PACKAGING CORP** **NY LTANKS** **S102234009**
West **123 LARNED ST** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.381 mi.
2012 ft. **Site 1 of 2 in cluster AG**

Relative: LTANKS:
Lower

Actual: **390 ft.**

Name:	H.S.M.PACKAGING CORP
Address:	123 LARNED ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9605294 / 1996-09-30
Facility ID:	9605294
Site ID:	228231
Spill Date:	1996-07-24
Spill Cause:	Tank Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1996-07-24
CID:	199
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1996-07-24
Spill Record Last Update:	1996-11-15
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	BOB DAVEY
Spiller Phone:	Not reported

H.S.M.PACKAGING CORP (Continued) **S102234009**

Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	188268
Latitude:	43.0408859
Longitude:	-76.1537705
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	working on const site a tank was found underground - tank is believed to be a 3000 gal tank - there is residue of contamination around the tank in the soil - tank will be pumped out tonight and tank dug out tomarrow - caller states tom mclaughlin from the region office was notified

All Materials:

Site ID:	228231
Operable Unit ID:	1036177
Operable Unit:	01
Material ID:	348043
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

AG138 **H.S.M.PACKAGING CORP** **UST FINDER RELEASE** **1029063640**
West **123 LARNED ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.381 mi.
2012 ft. **Site 2 of 2 in cluster AG**

Relative: **Lower**

Actual: **390 ft.**

UST FINDER RELEASE:

Object ID:	249439
Facility ID:	NY188268
Lust ID:	NY9605294
Name:	H.S.M.PACKAGING CORP
Address:	123 LARNED ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1996/07/24 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	849
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported

H.S.M.PACKAGING CORP (Continued) **1029063640**

Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.15377
Y Coord:	43.04089
Latitude:	43.0408899999999
Longitude:	-76.1537699999999

---

139 **NYS ARMORY JEFFERSON ST.** **NY LTANKS** **S100177734**
North **JEFFERSON ST. ARMORY** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.383 mi.
2021 ft.

Relative: LTANKS:
Lower

Actual: Name:	NYS ARMORY JEFFERSON ST.
397 ft. Address:	JEFFERSON ST. ARMORY
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9110102 / 1992-01-08
Facility ID:	9110102
Site ID:	114453
Spill Date:	1991-12-19
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1992-01-08
SWIS:	3415
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1991-12-19
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1991-12-26
Spill Record Last Update:	1995-01-03
Spiller Name:	Not reported
Spiller Company:	ARMORY/DIV. OF MIT. & NAV
Spiller Address:	330 OLD NISKAYUNA RD.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	99816
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR

NYS ARMORY JEFFERSON ST. (Continued) **S100177734**

Remarks: 01/08/92: 3 TANKS PULLED, 2 WEST TANKS-1 OF THE THEM HAD SEVERAL PINHOLES,1 LARGE HOLE .25 DIA,DUG OUT CONTAMINATED SOIL,CONCRETE PAD STOPPED ANY FURTHER CONTAMINATION APPROX. 20YDS3 DIESEL TANK OKAY. CONTACT MICHAEL CANONICA NG FACILITY ENG. OFFICER.- TANK TEST FAILURE 2-1500 GALLON GAS, 1-2000 GALLON GAS.

All Materials:

Site ID:	114453
Operable Unit ID:	960113
Operable Unit:	01
Material ID:	418673
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

---

140 ENE 1/4-1/2 0.383 mi. 2024 ft.

CLARK HALL; CROUSE IRVIN.
ELIZABETH BLACKWELL ST
SYRACUSE, NY

NY LTANKS **S100129395**
N/A

Relative: Higher

Actual: 409 ft.

LTANKS:

Name:	CLARK HALL; CROUSE IRVIN.
Address:	ELIZABETH BLACKWELL ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8709940 / 1988-04-12
Facility ID:	8709940
Site ID:	114725
Spill Date:	1988-02-18
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1988-04-12
SWIS:	3415
Investigator:	CSCUIPLY
Referred To:	Not reported
Reported to Dept:	1988-02-18
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1988-03-07
Spill Record Last Update:	1988-05-12
Spiller Name:	Not reported
Spiller Company:	CROUSE IRVING HOSPITAL
Spiller Address:	IRVING AVE.
Spiller County:	001

CLARK HALL; CROUSE IRVIN. (Continued) **S100129395**

Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	100049
Latitude:	43.0431299
Longitude:	-76.1392100
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CC 02/22/88: TANKS PULLED ON 02/19/88. EXPLOSIVE VAPORS PERSIST. 04/12/88: TANKS: CONTAMINATED SOIL REMOVED. DISCHARGE INTO STORM SEWER SUBSIDED.
Remarks:	FAILURE RATE +.279 GPH

All Materials:

Site ID:	114725
Operable Unit ID:	914871
Operable Unit:	01
Material ID:	461729
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

AH141 **PRESIDENTIAL PLAZA** **UST FINDER RELEASE** **1029067936**
NNE **90 PRESIDENTIAL PLAZA** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.385 mi.
2034 ft. **Site 1 of 3 in cluster AH**

Relative:
Higher

Actual:
401 ft.

UST FINDER RELEASE:

Object ID:	249519
Facility ID:	NY240602
Lust ID:	NY8906852
Name:	PRESIDENTIAL PLAZA
Address:	90 PRESIDENTIAL PLAZA
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1989/10/12 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1518
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported

PRESIDENTIAL PLAZA (Continued) **1029067936**

WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.14502
Y Coord:	43.04722
Latitude:	43.04722
Longitude:	-76.14502

AH142 **PRESIDENTIAL PLAZA** **NY LTANKS** **S100128205**
NNE **90 PRESIDENTIAL PLAZA** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.385 mi.
2034 ft. **Site 2 of 3 in cluster AH**

Relative: **Higher**

Actual: **401 ft.**

LTANKS:

Name:	PRESIDENTIAL PLAZA
Address:	90 PRESIDENTIAL PLAZA
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8906852 / 1989-10-12
Facility ID:	8906852
Site ID:	297379
Spill Date:	1989-10-12
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Cleanup Ceased:	1989-10-12
SWIS:	3415
Investigator:	GREGG
Referred To:	Not reported
Reported to Dept:	1989-10-12
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	SUTTON COMPANY
Spiller Address:	200 LOEW BLDG
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	240602
Latitude:	43.0472231
Longitude:	-76.1450246

PRESIDENTIAL PLAZA (Continued) **S100128205**

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was TG
Remarks: FOUN CONTAMINATED SOIL WHILE REMOVING 2 10000 GAL TANKS.

All Materials:
Site ID: 297379
Operable Unit ID: 934638
Operable Unit: 01
Material ID: 443668
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: Not reported
Recovered: .00
Resource Affected: Groundwater
Oxygenate: Not reported

---

143 **ATLAS LINEN** **UST FINDER RELEASE** **1029069745**
WSW **320 WEST TAYLOR ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.388 mi.
2049 ft.

Relative: **Lower**
Actual: **390 ft.**

UST FINDER RELEASE:
Object ID: 249446
Facility ID: NY263105
Lust ID: NY1641
Name: ATLAS LINEN
Address: 320 WEST TAYLOR ST
City,State,Zip: SYRACUSE, NY 0
Address Match Type: Not reported
Reported Date: 2000/05/09 15:59:59+00
Status: No Further Action
Substance: Not reported
Population within 1500ft: 517
Domestic Wells within 1500ft: 0
Land Use: Developed, High Intensity
Within SPA: No
SPA PWS Facility ID: Not reported
SPA Water Type: Not reported
SPA Facility Type: Not reported
SPA HUC12: Not reported
Within WHPA: No
WHPA PWS Facility ID: Not reported
WHPA Water Type: Not reported
WHPA Facility Type: Not reported
WHPA HUC12: Not reported
Within 100yr Floodplain: Yes
Tribe: Not reported
EPA Region: 2
NFA Letter 1: Not reported
NFA Letter 2: Not reported
NFA Letter 3: Not reported
NFA Letter 4: Not reported
Closed With Residual Contaminate: Not reported
Coordinate Source: State

ATLAS LINEN (Continued) **1029069745**

X Coord:	-76.1531199999999
Y Coord:	43.0388400000001
Latitude:	43.03884
Longitude:	-76.15312

AI144 **V.A. MEDICAL CENTER** **UST FINDER RELEASE** **1029063478**
ESE **800 IRIVING AVENUE** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.391 mi.
2064 ft. **Site 1 of 2 in cluster AI**

Relative: **Higher**
Actual: **502 ft.**

UST FINDER RELEASE:

Object ID:	249570
Facility ID:	NY186304
Lust ID:	NY9807877
Name:	V.A. MEDICAL CENTER
Address:	800 IRIVING AVENUE
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1998/09/28 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	2150
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1381
Y Coord:	43.03939
Latitude:	43.0393899999999
Longitude:	-76.1380999999999

AI145 **V.A. MEDICAL CENTER** **NY LTANKS** **S103479683**
ESE **800 IRIVING AVENUE** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.391 mi.
2064 ft. **Site 2 of 2 in cluster AI**

Relative:
Higher

Actual:
502 ft.

LTANKS:

Name:	VA HOSPITAL
Address:	800 IRIVING AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0402165 / 2004-09-29
Facility ID:	0402165
Site ID:	242917
Spill Date:	2004-05-27
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	BFMATTHE
Referred To:	Not reported
Reported to Dept:	2004-05-27
CID:	444
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2004-05-27
Spill Record Last Update:	2004-09-29
Spiller Name:	JOHN SLICK
Spiller Company:	VA HOSPITAL
Spiller Address:	800 IRVING AVE
Spiller County:	001
Spiller Contact:	JOHN SLICK
Spiller Phone:	(315) 425-3761
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	186304
Latitude:	43.0393949
Longitude:	-76.1381025
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BM CLOSURE REPORT SHOWS CLEAN.
Remarks:	3000 GALLON TANK WAS REMOVED HAD HOLES AND CONTAMINATED SOIL: THOUGHT TO BE EMPTIED UNSURE WHAT RELEASED: NOT MUCH IN HOLE:

All Materials:

Site ID:	242917
Operable Unit ID:	885972
Operable Unit:	01
Material ID:	489804
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00

V.A. MEDICAL CENTER (Continued) **S103479683**

Resource Affected:	Groundwater
Oxygenate:	Not reported
Name:	V.A. MEDICAL CENTER
Address:	800 IRIVING AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9807877 / 2002-08-06
Facility ID:	9807877
Site ID:	242920
Spill Date:	1998-09-28
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1998-09-28
CID:	312
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1998-09-28
Spill Record Last Update:	2002-08-06
Spiller Name:	JAMES LITTLEFIELD
Spiller Company:	V.A. MEDICAL CENTER
Spiller Address:	800 IRVING AVE
Spiller County:	001
Spiller Contact:	JAMES LITTLEFIELD
Spiller Phone:	(716) 892-5052
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	186304
Latitude:	43.0393949
Longitude:	-76.1381025
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM NO DATA SUBMITTED
Remarks:	WORK SITE PHONE #716-830-3093 DON ALDRICH - POSS LEAKING PIPES FROM TANK

AH146 **PRESIDENTIAL PLAZA** **NY LTANKS** **S102678249**
NNE **PRESIDENTIAL PLAZA** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.393 mi.
2074 ft. **Site 3 of 3 in cluster AH**

Relative: **Higher**
Actual: **400 ft.**

LTANKS:

Name:	PRESIDENTIAL PLAZA
Address:	PRESIDENTIAL PLAZA
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9407228 / 2002-08-06
Facility ID:	9407228
Site ID:	250694

PRESIDENTIAL PLAZA (Continued) **S102678249**

Spill Date:	1994-07-08
Spill Cause:	Tank Overfill
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	D5
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1994-07-08
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1994-10-31
Spill Record Last Update:	2002-08-06
Spiller Name:	Not reported
Spiller Company:	JOHN FRANTZ
Spiller Address:	50 PRESUDENTIAL PLAZA
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	205504
Latitude:	43.0410399
Longitude:	-76.1464500
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM 08/26/94: REPORT SUBMITTED. MINIMAL CONTAMINATION. 09/28/95: This is additional information about material spilled from the translation of the old spill file: TANK REMOVAL.
Remarks:	TANK(S) REMOVAL, ABANDEND TANK REAL REALESTATE TRANSACTION

All Materials:

Site ID:	250694
Operable Unit ID:	1001476
Operable Unit:	01
Material ID:	380242
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

147
NE
1/4-1/2
0.409 mi.
2162 ft.

MEDICAL RESEARCH BLDG
625 MADISON STREET
SYRACUSE, NY

NY LTANKS
NY Spills

S104790422
N/A

Relative:
Higher

Actual:
406 ft.

LTANKS:

Name:	HUTCHINGS PHSYC CENTER
Address:	625 MADISON STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0411489 / 2005-04-14
Facility ID:	0411489
Site ID:	336700
Spill Date:	2005-01-25
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	2005-01-25
CID:	444
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2005-01-25
Spill Record Last Update:	2005-04-14
Spiller Name:	TRACI SHIFFLET
Spiller Company:	HUTCHINGS PHSYC CENTER
Spiller Address:	625 MADISON STREET
Spiller County:	001
Spiller Contact:	TRACI SHIFFLET
Spiller Phone:	(315) 473-4980
Spiller Extention:	4992
DEC Region:	7
DER Facility ID:	272028
Latitude:	43.0454540
Longitude:	-76.1394410
DEC Memo:	Not reported
Remarks:	PBS No: 7-041904

All TTF:

Facility ID:	0411489
Spill Number:	0411489
Spill Tank Test:	1548528
Site ID:	336700
Tank Number:	003
Tank Size:	10000
Material:	0001
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II

MEDICAL RESEARCH BLDG (Continued) **S104790422**

Leak Rate: .00
Gross Fail: Not reported
Modified By: Watchdog
Last Modified Date: Not reported

All Materials:
Site ID: 336700
Operable Unit ID: 1098709
Operable Unit: 01
Material ID: 578885
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: G
Recovered: .00
Resource Affected: Groundwater
Oxygenate: Not reported

SPILLS:
Name: MEDICAL RESEARCH BLDG
Address: 625 MADISON STREET
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 0008056 / 2000-10-31
Facility ID: 0008056
Facility Type: ER
DER Facility ID: 272028
Site ID: 252960
DEC Region: 7
Spill Cause: Unknown
Spill Class: B3
SWIS: 3415
Spill Date: 2000-10-10
Investigator: CFMANNES
Referred To: Not reported
Reported to Dept: 2000-10-10
CID: 211
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: 2000-10-10
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2000-10-10
Spill Record Last Update: 2000-11-02
Spiller Name: Not reported
Spiller Company: MEDICAL RESEARCH BLDG
Spiller Address: 625 MADISON ST
Spiller Company: 001
Contact Name: Not reported
Latitude: 43.0454887

MEDICAL RESEARCH BLDG (Continued) **S104790422**

Longitude:	-76.1410635
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	PRODUCT SPILLED INTO SINK AND IS NOW CRYSTALIZING - REQ DEC REP TO SCENE - FIRE DEPT ON SCENE

All Materials:

Site ID:	252960
Operable Unit ID:	830514
Operable Unit:	01
Material ID:	566100
Material Code:	0036B
Material Name:	carbolic acid
Case No.:	00108952
Material FA:	Hazardous Material
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

AJ148 **743 IRVING AVE.** **UST FINDER RELEASE** **1029060626**
East **743 IRVING AVE** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.414 mi.
2188 ft. **Site 1 of 2 in cluster AJ**

Relative:
Higher

Actual:
498 ft.

UST FINDER RELEASE:

Object ID:	249572
Facility ID:	NY151618
Lust ID:	NY9101558
Name:	743 IRVING AVE.
Address:	743 IRVING AVE
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1991/05/08 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	2412
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported

743 IRVING AVE. (Continued) **1029060626**

Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1378
Y Coord:	43.0408800000001
Latitude:	43.04088
Longitude:	-76.1377999999999

AJ149 **743 IRVING AVE.** **NY LTANKS** **S100130939**
East **743 IRVING AVE** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.414 mi.
2188 ft. **Site 2 of 2 in cluster AJ**

Relative: **Higher**

Actual: **498 ft.**

LTANKS:

Name:	743 IRVING AVE.
Address:	743 IRVING AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9101558 / 1991-05-08
Facility ID:	9101558
Site ID:	180766
Spill Date:	1991-05-08
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	1991-05-08
SWIS:	3415
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1991-05-08
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	CROUSE IRVING HOSPITAL
Spiller Address:	743 IRVING AVE.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	151618
Latitude:	43.0408837
Longitude:	-76.1377985
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 05/08/91: CONTENTS OF TANK LEAKED AS TANK WAS BEING REMOVED FROM TANK PIT.SOIL WAS EVCAVATED FROM SITE IMMEADIATELY AND STAGED FOR DISPOSAL. Not reported
Remarks:	CONTAMINATED SOIL DISCOVERED DURING TANK REMOVAL.

All Materials:

Site ID:	180766

743 IRVING AVE. (Continued) **S100130939**

Operable Unit ID:	952671
Operable Unit:	01
Material ID:	427664
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	8.00
Resource Affected:	Soil
Oxygenate:	Not reported

AK150 **CASTLE REST NURSE HOME** **NY LTANKS** **S102677879**
SSE **401 E CASTLE ST** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.418 mi.
2209 ft. **Site 1 of 2 in cluster AK**

Relative: LTANKS:
Higher

Name:	CASTLE REST NURSE HOME
Address:	401 E CASTLE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9011086 / 1991-01-31
Facility ID:	9011086
Site ID:	149961
Spill Date:	1991-01-18
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	C3
Cleanup Ceased:	1991-01-20
SWIS:	3415
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1991-01-18
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1991-01-31
Spill Record Last Update:	1991-01-31
Spiller Name:	Not reported
Spiller Company:	CASTLE REST NURSING HOME
Spiller Address:	401 E.CASTLE ST.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	127530
Latitude:	43.0343204
Longitude:	-76.1439990
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR

Actual:
405 ft.

CASTLE REST NURSE HOME (Continued) **S102677879**

Remarks:	01/31/91: MOST OF THE SPILL WAS CONTAINED ON A CONCRETE PAD BENEATH THE VENT WHERE THE OVERFILL DISCHARGED SOME CONTAMINATED SOIL WAS STAGED IN DRUMS AT THE SCENE. TO BE REMOVED BY EPS. CUSTOMER ORDERED TOO MUCH FUEL FOR TANK. FUEL WENT INTO DITCH ON OUT-SIDE OF BUILDING.

All Materials:

Site ID:	149961
Operable Unit ID:	948098
Operable Unit:	01
Material ID:	431177
Material Code:	0002A
Material Name:	#4 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	2.00
Resource Affected:	Soil
Oxygenate:	Not reported

AK151 **CASTLE REST NURSE HOME** **UST FINDER RELEASE** **1029058680**
SSE **401 E CASTLE ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.418 mi.
2209 ft. **Site 2 of 2 in cluster AK**

Relative: **Higher**
Actual: **405 ft.**

UST FINDER RELEASE:

Object ID:	249524
Facility ID:	NY127530
Lust ID:	NY9011086
Name:	CASTLE REST NURSE HOME
Address:	401 E CASTLE ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1991/01/18 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	2016
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported

CASTLE REST NURSE HOME (Continued) **1029058680**

NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1439999999999
Y Coord:	43.03432
Latitude:	43.03432
Longitude:	-76.144

152
NE
1/4-1/2
0.419 mi.
2212 ft.

Relative:
Higher

Actual:
403 ft.

HUTCHINGS PSYCH CENTER
540 CEDAR - BUILDING #1
SYRACUSE, NY 12310

RCRA-VSQG **1000170847**
NY LTANKS **NYD980785315**
NY Spills
ICIS
FINDS
ECHO
E MANIFEST
NY MANIFEST

RCRA Listings:

Date Form Received by Agency:	20240228
Handler Name:	Hutchings Psychiatric Center
Handler Address:	Cedar St
Handler City,State,Zip:	SYRACUSE, NY 13210-2319
EPA ID:	NYD980785315
Contact Name:	PAUL S BROWN
Contact Address:	CEDAR ST
Contact City,State,Zip:	SYRACUSE, NY 13210
Contact Telephone:	315-426-3966
Contact Fax:	315-426-3967
Contact Email:	PAUL.BROWN4@OMH.NY.US
Contact Title:	PLANT SUPERINTENDENT
EPA Region:	02
Land Type:	State
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	CEDAR ST
Mailing City,State,Zip:	SYRACUSE, NY 13210
Owner Name:	New York State Office Of Mental Health
Owner Type:	State
Operator Name:	Hutchings Psychiatric Center
Operator Type:	State
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20240229
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	D002
Waste Description:	Corrosive Waste
Waste Code:	D003
Waste Description:	Reactive Waste
Waste Code:	D008
Waste Description:	Lead
Waste Code:	D009
Waste Description:	Mercury
Waste Code:	D010
Waste Description:	Selenium
Waste Code:	D011
Waste Description:	Silver
Waste Code:	D024
Waste Description:	M-Cresol
Waste Code:	D026
Waste Description:	Cresol

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Waste Code: P001
Waste Description: 2h-1-Benzopyran-2-One, 4-Hydroxy-3-(3-Oxo-1-Phenylbutyl)-, & Salts, When Present At Concentrations Greater Than 0.3% (Or) Warfarin, & Salts, When Present At Concentrations Greater Than 0.3%

Waste Code: P042
Waste Description: 1,2-Benzenediol, 4-[1-Hydroxy-2-(Methylamino)Ethyl]-, (R)- (Or) Epinephrine

Waste Code: P075
Waste Description: Nicotine, & Salts (Or) Pyridine, 3-(1-Methyl-2-Pyrrolidinyl)-,(S)-, & Salts

Waste Code: U034
Waste Description: Acetaldehyde, Trichloro- (Or) Chloral

Waste Code: U129
Waste Description: Cyclohexane, 1,2,3,4,5,6-Hexachloro-, (1alpha, 2alpha, 3beta, 4alpha, 5alpha, 6beta)- (Or) Lindane

Waste Code: U150
Waste Description: L-Phenylalanine, 4-[Bis(2-Chloroethyl)Amino]- (Or) Melphalan

Waste Code: U154
Waste Description: Methanol (I) (Or) Methyl Alcohol (I)

Waste Code: U205
Waste Description: Selenium Sulfide (Or) Selenium Sulfide Ses2 (R,T)

Waste Code: X002
Waste Description: Not Defined

Handler - Owner Operator:
Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 44 HOLLAND AVE
Owner/Operator City,State,Zip: ALBANY, NY 12229
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 44 HOLLAND AVE
Owner/Operator City,State,Zip: ALBANY, NY 12229
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Owner/Operator Indicator:	Operator
Owner/Operator Name:	HUTCHINGS PSYCHIATRIC CENTER
Legal Status:	State
Date Became Current:	19780401
Date Ended Current:	Not reported
Owner/Operator Address:	620 MADISON AVE
Owner/Operator City,State,Zip:	SYRACUSE, NY 13210
Owner/Operator Telephone:	315-426-3966
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	315-426-3967
Owner/Operator Email:	PAUL.BROWN4@OMH.NY.GOV

Owner/Operator Indicator:	Operator
Owner/Operator Name:	HUTCHINGS PSYCHIATRIC CENTER
Legal Status:	State
Date Became Current:	19780401
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	HUTCHINGS PSYCHIATRIC CENTER
Legal Status:	State
Date Became Current:	19780401
Date Ended Current:	Not reported
Owner/Operator Address:	620 MADISON AVE
Owner/Operator City,State,Zip:	SYRACUSE, NY 13210
Owner/Operator Telephone:	315-426-3966
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	315-426-3967
Owner/Operator Email:	PAUL.BROWN4@OMH.NY.GOV

Owner/Operator Indicator:	Operator
Owner/Operator Name:	HUTCHINGS PSYCHIATRIC CENTER
Legal Status:	State
Date Became Current:	19780401
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	HUTCHINGS PSYCHIATRIC CENTER
Legal Status:	State
Date Became Current:	19780401
Date Ended Current:	Not reported
Owner/Operator Address:	620 MADISON AVE
Owner/Operator City,State,Zip:	SYRACUSE, NY 13210
Owner/Operator Telephone:	315-426-3966
Owner/Operator Telephone Ext:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Owner/Operator Fax: 315-426-3967
Owner/Operator Email: PAUL.BROWN4@OMH.NY.GOV

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 620 MADISON ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 75 NEW SCOTLAND AVE
Owner/Operator City,State,Zip: ALBANY, NY 12208
Owner/Operator Telephone: 518-549-5118
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: ERICA.CRUDEN@OMH.NY.GOV

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 75 NEW SCOTLAND AVE
Owner/Operator City,State,Zip: ALBANY, NY 12208
Owner/Operator Telephone: 518-549-5118
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: ERICA.CRUDEN@OMH.NY.GOV

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 620 MADISON ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HUTCHINGS PSYCHIATRIC CENTER
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 620 MADISON AVE

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-426-3966
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: 315-426-3967
Owner/Operator Email: PAUL.BROWN4@OMH.NY.GOV

Owner/Operator Indicator: Owner
Owner/Operator Name: OWNERNAME
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HUTCHINGS PSYCHIATRIC CENTER
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HUTCHINGS PSYCHIATRIC CENTER
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 75 NEW SCOTLAND AVE
Owner/Operator City,State,Zip: ALBANY, NY 12208
Owner/Operator Telephone: 518-549-5118
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: JIMMY.NG@OMH.NY.GOV

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Date Became Current:	19780401
Date Ended Current:	Not reported
Owner/Operator Address:	75 NEW SCOTLAND AVE
Owner/Operator City,State,Zip:	ALBANY, NY 12208
Owner/Operator Telephone:	518-549-5118
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	JIMMY.NG@OMH.NY.GOV

Historic Generators:

Receive Date:	19990708
Handler Name:	HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20060430
Handler Name:	HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20071028
Handler Name:	HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	19850102
Handler Name:	HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060501
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20071029
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20110318
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20110504
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Receive Date: 20180622
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20190701
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20230905
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20240228
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

List of NAICS Codes and Descriptions:
NAICS Code: 62221
NAICS Description: PSYCHIATRIC AND SUBSTANCE ABUSE HOSPITALS

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Has the Facility Received Notices of Violations:
Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:
Evaluation Date: 20170601
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier: NYBRS
Evaluation Responsible Sub-Organization: R7
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

LTANKS:
Name: HUTCHINGS PSYCH CENTER

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8802339 / 1990-01-24
Facility ID:	8802339
Site ID:	78437
Spill Date:	1988-06-15
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1990-01-24
SWIS:	3415
Investigator:	GREGG
Referred To:	Not reported
Reported to Dept:	1918-06-15
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1988-06-20
Spill Record Last Update:	1990-01-25
Spiller Name:	Not reported
Spiller Company:	HUTCHING PSYCH CENTER
Spiller Address:	SEE ABOVE
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	169331
Latitude:	43.0461809
Longitude:	-76.1420831
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was TG 06/14/88: BOTH TANKS WERE PREVIOUSLY TESTED ON 06/14/88. BOTH FAILED. -.6414 GPH & -.4962GPH.
Remarks:	TANK TEST FAILURES FROM FIBERGLASS TANKS THAT HAVE AN AIR POCKET THAT CAN NOT BE RELIEVED.

All Materials:

Site ID:	78437
Operable Unit ID:	917666
Operable Unit:	01
Material ID:	457910
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

Name:	HUTCHINGS

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8710954 / 1988-06-09
Facility ID:	8710954
Site ID:	203614
Spill Date:	1988-03-31
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1988-06-09
SWIS:	3415
Investigator:	AJMARSCH
Referred To:	Not reported
Reported to Dept:	1988-03-31
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1988-04-06
Spill Record Last Update:	1988-06-14
Spiller Name:	Not reported
Spiller Company:	NYS OGS (HUTCHINGS PSYCH)
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	169331
Latitude:	43.0461809
Longitude:	-76.1420831
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was JM
Remarks:	06/09/88: TANK WAS RETESTED TIGHT. PIPING WAS REPAIRED IN MAY OF 88. CONTACT GERRY MARTIN EXT. 4992 2500 GAL.TANK TEST OK PIPING FAILED HORNER EZ AT -0.1199 GPH.

All Materials:

Site ID:	203614
Operable Unit ID:	916818
Operable Unit:	01
Material ID:	462699
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

SPILLS:

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Name:	HUTCHINGS PSYCHIATRIC CTR
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0209541 / 2002-12-17
Facility ID:	0209541
Facility Type:	ER
DER Facility ID:	169331
Site ID:	203612
DEC Region:	7
Spill Cause:	Human Error
Spill Class:	C3
SWIS:	3415
Spill Date:	2002-12-16
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2002-12-17
CID:	211
Water Affected:	Not reported
Spill Source:	Tank Truck
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2002-12-17
Spill Record Last Update:	2002-12-17
Spiller Name:	DAN STOWELL
Spiller Company:	GRIFFITH ENERGY
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0461809
Longitude:	-76.1420831
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	DRIVER DID NOT SHUT NOZZLE COMPLETELY AFTER FILL UP - 1/2 GAL OF PRODUCT CLEANED UP

All Materials:

Site ID:	203612
Operable Unit ID:	862621
Operable Unit:	01
Material ID:	512962
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	1.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	HUTCHINGS PSYC CENTER
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Spill Number/Closed Date:	0460027 / 2004-08-31
Facility ID:	0460027
Facility Type:	ER
DER Facility ID:	169331
Site ID:	203613
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D3
SWIS:	3415
Spill Date:	2004-06-22
Investigator:	CXROSSI
Referred To:	Not reported
Reported to Dept:	2004-06-23
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Non Major Facility > 1,100 gal
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	2004-06-24
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-07-23
Spill Record Last Update:	2004-08-31
Spiller Name:	RICK HOWARD
Spiller Company:	HUTCHINGS
Spiller Address:	500 CEDAR ST
Spiller Company:	001
Contact Name:	RICK HOWARD
Latitude:	43.0461730
Longitude:	-76.1420780
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CTR soil borings in tank pit
	area revealed localized and minor petroleum contamination.
Remarks:	believed to be less than 10 gallons. filled tank for tightness test
	and it leaked around manhole. Orginally listed as spill number
	0403194, and somehow listed also as 0000031.

All Materials:

Site ID:	203613
Operable Unit ID:	890843
Operable Unit:	01
Material ID:	485586
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	HUTCHINGS
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Spill Number/Closed Date:	8910136 / 1990-01-23
Facility ID:	8910136
Facility Type:	ER
DER Facility ID:	169331
Site ID:	203615
DEC Region:	7
Spill Cause:	Human Error
Spill Class:	Not reported
SWIS:	3415
Spill Date:	1990-01-23
Investigator:	GREGG
Referred To:	Not reported
Reported to Dept:	1990-01-23
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	1990-01-23
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	HUTCHINGS PSYCH CENTER
Spiller Address:	620 MADISON
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0461809
Longitude:	-76.1420831
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was TG
Remarks:	EMPLOYEE DROPPED CONTAINER OF BLEACH. SITUATION NUTRALIZED.

All Materials:

Site ID:	203615
Operable Unit ID:	935224
Operable Unit:	01
Material ID:	443257
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Site ID:	203615
Operable Unit ID:	935224
Operable Unit:	01
Material ID:	443258
Material Code:	0466A
Material Name:	bleach
Case No.:	Not reported
Material FA:	Other

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	TRANSPORTATION DEPT. OF H
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0403194 / 2004-12-21
Facility ID:	0403194
Facility Type:	ER
DER Facility ID:	169331
Site ID:	78436
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D3
SWIS:	3415
Spill Date:	2004-06-22
Investigator:	CXROSSI
Referred To:	Not reported
Reported to Dept:	2004-06-23
CID:	444
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	2004-06-22
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-06-23
Spill Record Last Update:	2004-12-21
Spiller Name:	RICK HOWARD
Spiller Company:	TRANSPORTATION DEPT. OF H
Spiller Address:	500 CEDAR ST.
Spiller Company:	001
Contact Name:	RICK HOWARD
Latitude:	43.0461730
Longitude:	-76.1420780
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was
Remarks:	BELEIAVED TO BE LESS THAN 10 GALLONS, TIGHTENING TANK AND IT LEAKED, LEAKED INTO A CONTAINED AREA, NO CLEANUP IN PROGRESS, SPILL IS BELOW THE MANHOLE

All Materials:

Site ID:	78436
Operable Unit ID:	886640
Operable Unit:	01
Material ID:	490787
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Recovered: 5.00
Resource Affected: Soil
Oxygenate: Not reported

ICIS:
Enforcement Action ID: 02-2009-0832
FRS ID: 110004392924
Action Name: Hutchings Psychiatric Center - NYSOMH
Facility Name: HUTCHINGS PSYCHIATRIC CENTER
Facility Address: 500 CEDAR ST
SYRACUSE, NY 132102319
Enforcement Action Type: RCRA 3008A AO For Comp And/Or Penalty
Facility County: ONONDAGA
Program System Acronym: RCRAINFO
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: 3008A
Facility SIC Code: Not reported
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 43.04623
Longitude in Decimal Degrees: -76.1422
Permit Type Desc: Not reported
Program System Acronym: NYD980785315
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Facility Name: HUTCHINGS PSYCHIATRIC CENTER
Address: 500 CEDAR ST
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: Not reported

Facility Name: HUTCHINGS PSYCHIATRIC CENTER
Address: 500 CEDAR ST
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: Not reported

FINDS:
Registry ID: 110004392924

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

ECHO:

Envid:	1000170847
Registry ID:	110004392924
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110004392924
Name:	HUTCHINGS PSYCHIATRIC CENTER
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY 13210

E MANIFEST:

Manifest Tracking Number:	010983353FLE
Last Updated Date:	20190212
Shipped Date:	20180706
Received Date:	20180710
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR ST
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13210-2319
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR ST
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location Zip:	13210
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	MID048090633
Designated Facility Name:	Wayne Disposal Inc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	49350 N I94 SERVICE DR
Designated Facility Mail City:	BELLEVILLE
Designated Facility Mail Zip:	48111
Designated Facility Mail State:	MI
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	49350 N I94 SERVICE DR
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	BELLEVILLE
Designated Facility Location Zip:	48111
Designated Facility Location State:	MI
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	010983384FLE
Last Updated Date:	20190212
Shipped Date:	20180904
Received Date:	20180905
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR ST
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13210-2319
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR ST
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location Zip:	13210
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	MID048090633
Designated Facility Name:	Wayne Disposal Inc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	49350 N I94 SERVICE DR
Designated Facility Mail City:	BELLEVILLE
Designated Facility Mail Zip:	48111
Designated Facility Mail State:	MI
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	49350 N I94 SERVICE DR
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	BELLEVILLE
Designated Facility Location Zip:	48111
Designated Facility Location State:	MI
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	013274231FLE
Last Updated Date:	20191006
Shipped Date:	20190821
Received Date:	20190910
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR STREET
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13210
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 Cedar Street
Generator Location Street 2:	Not reported
Generator Location City:	Syracuse
Generator Location Zip:	13210
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	ARD069748192
Designated Facility Name:	Clean Harbors El Dorado Llc

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	309 American Circle
Designated Facility Mail City:	El Dorado
Designated Facility Mail Zip:	71730
Designated Facility Mail State:	AR
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	309 American Circle
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	El Dorado
Designated Facility Location Zip:	71730
Designated Facility Location State:	AR
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	012191539FLE
Last Updated Date:	20191017
Shipped Date:	20181114
Received Date:	20181121
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Web
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR ST
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13210-2319
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR ST
Generator Location Street 2:	ATTN: ENVIRONMENTAL MANAGER
Generator Location City:	SYRACUSE
Generator Location Zip:	13210
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	PAD067098822
Designated Facility Name:	Cyclechem Inc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	550 INDUSTRIAL DR
Designated Facility Mail City:	LEWISBERRY
Designated Facility Mail Zip:	17339
Designated Facility Mail State:	PA
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	550 INDUSTRIAL DR
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	LEWISBERRY
Designated Facility Location Zip:	17339
Designated Facility Location State:	PA
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	012191541FLE

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Last Updated Date:	20190212
Shipped Date:	20181119
Received Date:	20181120
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR ST
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13210-2319
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR ST
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location Zip:	13210
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	MID048090633
Designated Facility Name:	Wayne Disposal Inc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	49350 N I94 SERVICE DR
Designated Facility Mail City:	BELLEVILLE
Designated Facility Mail Zip:	48111
Designated Facility Mail State:	MI
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	49350 N I94 SERVICE DR
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	BELLEVILLE
Designated Facility Location Zip:	48111
Designated Facility Location State:	MI
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	015217859FLE
Last Updated Date:	20201217
Shipped Date:	20201008
Received Date:	20201024
Manifest Status:	Corrected
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR STREET
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13210
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 Cedar Street
Generator Location Street 2:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Generator Location City:	Syracuse
Generator Location Zip:	13210
Generator Location State:	NY
Generator Contact Company Name:	Hutchings Psychiatric Center
Designated Facility EPA ID:	ARD069748192
Designated Facility Name:	Clean Harbors El Dorado Llc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	309 American Circle
Designated Facility Mail City:	El Dorado
Designated Facility Mail Zip:	71730
Designated Facility Mail State:	AR
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	309 American Circle
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	El Dorado
Designated Facility Location Zip:	71730
Designated Facility Location State:	AR
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	003463458GBF
Last Updated Date:	20190115
Shipped Date:	20181107
Received Date:	20181203
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psych Center
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	540 CEDAR - BUILDING #1
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	12310
Generator Location Street Number:	Not reported
Generator Location Street 1:	540 Cedar - Building #1
Generator Location Street 2:	Not reported
Generator Location City:	Syracuse
Generator Location Zip:	12310
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	VTR000517052
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	54
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	54 AVENUE D
Designated Facility Mail City:	WILLISTON
Designated Facility Mail Zip:	05495
Designated Facility Mail State:	VT
Designated Facility Location Street Number:	54
Designated Facility Location Street 1:	54 AVENUE D
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	WILLISTON
Designated Facility Location Zip:	05495

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Designated Facility Location State:	VT
Designated Facility Contact Company Name:	ENPRO SERVICES OF VERMONT, INC.
Manifest Residue Indicator:	N
Rejection Indicator:	N
Manifest Tracking Number:	011861934FLE
Last Updated Date:	20181009
Shipped Date:	20180824
Received Date:	20180912
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR STREET
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13210
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 Cedar Street
Generator Location Street 2:	Not reported
Generator Location City:	Syracuse
Generator Location Zip:	13210
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	ARD069748192
Designated Facility Name:	Clean Harbors El Dorado Llc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	309 American Circle
Designated Facility Mail City:	El Dorado
Designated Facility Mail Zip:	71730
Designated Facility Mail State:	AR
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	309 American Circle
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	El Dorado
Designated Facility Location Zip:	71730
Designated Facility Location State:	AR
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N
Manifest Tracking Number:	011861937FLE
Last Updated Date:	20181001
Shipped Date:	20180824
Received Date:	20180905
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR STREET
Generator Mail Street 2:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13210
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 Cedar Street
Generator Location Street 2:	Not reported
Generator Location City:	Syracuse
Generator Location Zip:	13210
Generator Location State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	OHD000816629
Designated Facility Name:	Spring Grove Resource Recovery Inc.
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	4879 Spring Grove Avenue
Designated Facility Mail City:	Cincinnati
Designated Facility Mail Zip:	45232
Designated Facility Mail State:	OH
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	4879 Spring Grove Avenue
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	Cincinnati
Designated Facility Location Zip:	45232
Designated Facility Location State:	OH
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	017166820FLE
Last Updated Date:	20220707
Shipped Date:	20220518
Received Date:	20220617
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR STREET
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13210
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 Cedar Street
Generator Location Street 2:	Not reported
Generator Location City:	Syracuse
Generator Location Zip:	13210
Generator Location State:	NY
Generator Contact Company Name:	Hutchings Psychiatric Center
Designated Facility EPA ID:	ARD069748192
Designated Facility Name:	Clean Harbors El Dorado Llc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	309 American Circle
Designated Facility Mail City:	El Dorado
Designated Facility Mail Zip:	71730

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Designated Facility Mail State:	AR
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	309 American Circle
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	El Dorado
Designated Facility Location Zip:	71730
Designated Facility Location State:	AR
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	017166821FLE
Last Updated Date:	20220705
Shipped Date:	20220518
Received Date:	20220614
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR STREET
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail State:	NY
Generator Mail Zip:	13210
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 Cedar Street
Generator Location Street 2:	Not reported
Generator Location City:	Syracuse
Generator Location Zip:	13210
Generator Location State:	NY
Generator Contact Company Name:	Hutchings Psychiatric Center
Designated Facility EPA ID:	NCD000648451
Designated Facility Name:	Clean Harbors Reidsville Llc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	208 Watlington Industrial Drive
Designated Facility Mail City:	Reidsville
Designated Facility Mail Zip:	27320
Designated Facility Mail State:	NC
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	208 Watlington Industrial Drive
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	Reidsville
Designated Facility Location Zip:	27320
Designated Facility Location State:	NC
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Federal Waste:

Manifest Tracking Number:	017166821FLE
Waste Line Number:	1
Federal Waste Code:	D001
Federal Waste:	IGNITABLE WASTE

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Manifest Tracking Number: 017166821FLE
Waste Line Number: 2
Federal Waste Code: D024
Federal Waste: M-CRESOL

Manifest Tracking Number: 017166821FLE
Waste Line Number: 2
Federal Waste Code: D026
Federal Waste: CRESOL

Manifest Tracking Number: 017166821FLE
Waste Line Number: 2
Federal Waste Code: U205
Federal Waste: SELENIUM SULFIDE (OR) SELENIUM SULFIDE SES2 (R,T)

Transporter:
Manifest Tracking Number: 017166821FLE
Transporter Line Number: 1
Transporter EPA ID: MAD039322250
Transporter Name: Clean Harbors Environmental Services, Inc.

Manifest Tracking Number: 017166821FLE
Transporter Line Number: 2
Transporter EPA ID: MAD039322250
Transporter Name: Clean Harbors Environmental Services, Inc.

Manifest Tracking Number: 017166821FLE
Transporter Line Number: 3
Transporter EPA ID: MAD039322250
Transporter Name: Clean Harbors Environmental Services, Inc.

Manifest Tracking Number: 017166821FLE
Transporter Line Number: 4
Transporter EPA ID: NJD071629976
Transporter Name: Sj Transportation Co Inc

Manifest Tracking Number: 017166821FLE
Transporter Line Number: 5
Transporter EPA ID: NJD071629976
Transporter Name: Sj Transportation Co Inc

Waste Line:
Manifest Tracking Number: 017166821FLE
Waste Line Number: 1
U.S. DOT Hazardous Indicator: Y
U.S. DOT ID Number: UN1993
U.S. DOT Description: Un1993, Waste Flammable Liquids, N.O.S. (Alcohol, Alcohol Wipes), 3, Pg Ii
Non-Hazardous Waste Description: Not reported
Number of Containers: 1
Container Type Code: DF
Container Type Description: Fiberboard or plastic drums, barrels, kegs
Waste Quantity: 2
Quantity Unit of Measure Code: P
Quantity Unit of Measure Description: Pounds
Waste Quantity, in Tons: 0.001

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Acute Waste Quantity, in Tons:	0
Non-Acute Waste Quantity, in Tons:	0.001
Waste Quantity, in Kilograms:	0.90703005
Acute Waste Quantity, in Kilograms:	0
Non-Acute Waste Quantity, in Kilorgrams:	0.90703005
Management Method Code:	H141
Management Method Description:	STORAGE, BULKING AND/OR TRANSFER OFF SITE
Waste Residue Indicator:	N
Quantity Discrepancy Indicator:	N
Waste Type Discrepancy Indicator:	N
Waste Density:	Not reported
Waste Density Unit of Measure Code:	Not reported
Waste Density Unit of Measure Description:	Not reported
Form Code:	Not reported
Form Code Description:	Not reported
Source Code:	Not reported
Source Code Description:	Not reported
Waste Minimization Code:	Not reported
Waste Minimization Code Description:	Not reported
Consent Number:	Not reported
EPA Waste Indicator:	Y

Manifest Tracking Number:	017166821FLE
Waste Line Number:	2
U.S. DOT Hazardous Indicator:	Y
U.S. DOT ID Number:	UN3287
U.S. DOT Description:	Un3287, Waste Toxic Liquid, Inorganic, N.O.S (Insulin, Seleniumsulfide), 6.1, Pg Ii
Non-Hazardous Waste Description:	Not reported
Number of Containers:	1
Container Type Code:	DF
Container Type Description:	Fiberboard or plastic drums, barrels, kegs
Waste Quantity:	6
Quantity Unit of Measure Code:	P
Quantity Unit of Measure Description:	Pounds
Waste Quantity, in Tons:	0.003
Acute Waste Quantity, in Tons:	0
Non-Acute Waste Quantity, in Tons:	0.003
Waste Quantity, in Kilograms:	2.72109
Acute Waste Quantity, in Kilograms:	0
Non-Acute Waste Quantity, in Kilorgrams:	2.72109
Management Method Code:	H141
Management Method Description:	STORAGE, BULKING AND/OR TRANSFER OFF SITE
Waste Residue Indicator:	N
Quantity Discrepancy Indicator:	N
Waste Type Discrepancy Indicator:	N
Waste Density:	Not reported
Waste Density Unit of Measure Code:	Not reported
Waste Density Unit of Measure Description:	Not reported
Form Code:	Not reported
Form Code Description:	Not reported
Source Code:	Not reported
Source Code Description:	Not reported
Waste Minimization Code:	Not reported
Waste Minimization Code Description:	Not reported
Consent Number:	Not reported
EPA Waste Indicator:	Y

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Click this hyperlink while viewing on your computer to access
1 additional US EManifest: record(s) in the EDR Site Report.

NY MANIFEST:

EPA ID:	NYD980785315
Country:	USA
Name:	HUTCHINGS PSYCHIATRIC CENTER
Address:	500 CEDAR ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13210-2302
Zip 4:	Not reported
Location Address 1:	500 CEDAR STREET
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13210
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	HUTCHINGS PSYCHIATRIC CENTER
Mailing Contact:	DENNIS M. DALEY
Mailing Address 1:	620 MADISON STREET
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13210
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154734980

Manifest Data:

Document ID:	MDC0844341
Manifest Status:	Not reported
Trans1 State ID:	HWH123
Year:	2001
Trans2 State ID:	HWH822301
Generator Ship Date:	01/17/2001
Trans1 Recv Date:	01/17/2001
Trans2 Recv Date:	01/18/2001
TSD Site Recv Date:	01/25/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	SCR000075150
Trans2 EPA ID:	SCR000074591
TSDF ID 1:	MDD980554653
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

MGMT Method Type Code: Not reported
Waste Code 1: B007
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00221
Units: Kilograms
Number of Containers: 001
Container Type: Metal drums, barrels, kegs
Handling Method: Burn
Specific Gravity: 01.00

Document ID: NJA3205453
Manifest Status: Not reported
Trans1 State ID: 08690
Year: 2001
Trans2 State ID: H10364
Generator Ship Date: 01/17/2001
Trans1 Recv Date: 01/17/2001
Trans2 Recv Date: 01/18/2001
TSD Site Recv Date: 01/25/2001
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD980785315
Trans1 EPA ID: SCR000075150
Trans2 EPA ID: SCR000074591
TSDF ID 1: NJD002182897
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: IGNITABLE WASTE
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00362
Units: Pounds
Number of Containers: 001
Container Type: Metal drums, barrels, kegs
Handling Method: Burn
Specific Gravity: 01.00

Document ID: Not reported
Manifest Status: Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/03/2014
Trans1 Recv Date:	04/03/2014
Trans2 Recv Date:	04/09/2014
TSD Site Recv Date:	04/19/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	007469999FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code a:	IGNITABLE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	50
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/03/2014
Trans1 Recv Date:	04/03/2014
Trans2 Recv Date:	04/09/2014
TSD Site Recv Date:	04/19/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	007469999FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code a:	SELENIUM
Waste Code b:	SILVER
Waste Code c:	CRESOL
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/03/2014
Trans1 Recv Date:	04/03/2014
Trans2 Recv Date:	04/09/2014
TSD Site Recv Date:	04/19/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	007469999FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	MERCURY
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/03/2014
Trans1 Recv Date:	04/03/2014
Trans2 Recv Date:	04/09/2014
TSD Site Recv Date:	04/19/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	007469999FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code a:	2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% (OR) WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%
Waste Code b:	1,2-BENZENEDIOL, 4-[1-HYDROXY-2-(METHYLAMINO)ETHYL]-, (R)- (OR)

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

	EPINEPHRINE
Waste Code c:	NICOTINE, & SALTS (OR) PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, & SALTS
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/03/2014
Trans1 Recv Date:	04/03/2014
Trans2 Recv Date:	04/09/2014
TSD Site Recv Date:	04/19/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	007469999FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code a:	IGNITABLE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	30
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD080631369
Year:	2018
Trans2 State ID:	NJD054126164
Generator Ship Date:	07/22/2014
Trans1 Recv Date:	07/22/2014
Trans2 Recv Date:	07/25/2014
TSD Site Recv Date:	07/30/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD980536593
TSDF ID 2:	Not reported
Manifest Tracking Number:	000613369VES
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	IGNITABLE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1
Document ID:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/15/2015
Trans1 Recv Date:	04/15/2015
Trans2 Recv Date:	04/24/2015
TSD Site Recv Date:	04/29/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	008016853FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code a:	2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% (OR) WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%
Waste Code b:	NICOTINE, & SALTS (OR) PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, & SALTS
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/15/2015
Trans1 Recv Date:	04/15/2015
Trans2 Recv Date:	04/24/2015

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

TSD Site Recv Date:	04/29/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	008016853FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code a:	SELENIUM
Waste Code b:	SILVER
Waste Code c:	CRESOL
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	12
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/15/2015
Trans1 Recv Date:	04/15/2015
Trans2 Recv Date:	04/24/2015
TSD Site Recv Date:	04/29/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	008016853FLE
Import Indicator:	N

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code a:	CORROSIVE WASTE
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	180
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	1

Click this hyperlink while viewing on your computer to access
60 additional NY MANIFEST: record(s) in the EDR Site Report.

AL153 **CARRIER DOME** **NY LTANKS** **S100128018**
ESE **FOSTER DRIVE** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.423 mi.
2231 ft. **Site 1 of 2 in cluster AL**

Relative: LTANKS:
Higher

Actual: Name:	CARRIER DOME
498 ft. Address:	FOSTER DRIVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8903207 / 1989-09-27
Facility ID:	8903207
Site ID:	331199
Spill Date:	1989-06-27
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1989-09-27
SWIS:	3415
Investigator:	GREGG
Referred To:	Not reported
Reported to Dept:	1989-06-27
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester

CARRIER DOME (Continued) **S100128018**

Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1989-07-13
Spill Record Last Update:	1994-03-28
Spiller Name:	Not reported
Spiller Company:	SYRAUCSE UNIVERSITY
Spiller Address:	STEVE RICE
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	266367
Latitude:	43.4485460
Longitude:	-76.5290600
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was TG 06/27/89: WILL ISOLATE LINES AND RETEST. 11/15/89: TANK TEST FAILURE. TANK WAS RETESTED & TESTED TIGHT.
Remarks:	5,000 GAL. TANK. AINLEY TEST FAILURE RATE .0557 GPH.

All Materials:

Site ID:	331199
Operable Unit ID:	928625
Operable Unit:	01
Material ID:	557538
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

AM154 **CNY CENTRO INC.** **NY LTANKS** **S103570665**
SSW **200 CORTLAND AVE.** **NY CBS** **N/A**
1/4-1/2 **SYRACUSE, NY 13205** **NY Spills**
0.425 mi. **NY AIRS**
2244 ft. **Site 1 of 2 in cluster AM**

Relative:
Lower

Actual:
390 ft.

LTANKS:

Name:	CNY CENTRO INC.
Address:	200 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9413883 / 2002-08-06
Facility ID:	9413883
Site ID:	230780
Spill Date:	1995-01-18
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415

CNY CENTRO INC. (Continued) **S103570665**

Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1995-01-18
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1995-02-08
Spill Record Last Update:	2002-08-06
Spiller Name:	Not reported
Spiller Company:	CNY CENTRO INC.
Spiller Address:	200 CORTLAND AVENUE
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	190176
Latitude:	43.0363598
Longitude:	-76.1507518
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM NO REPORT SUBMITTED
Remarks:	TANK TEST FAILURE.

All Materials:

Site ID:	230780
Operable Unit ID:	1011411
Operable Unit:	01
Material ID:	372631
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	CNY CENTRO, INC.
Address:	200 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9508450 / 1995-10-11
Facility ID:	9508450
Site ID:	230781
Spill Date:	1995-10-11
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	D5
Cleanup Ceased:	1995-12-31
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported

CNY CENTRO INC. (Continued) **S103570665**

Reported to Dept:	1995-10-11
CID:	266
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1995-10-11
Spill Record Last Update:	1996-01-02
Spiller Name:	DAVID RYAN
Spiller Company:	CNY CENTRO, INC.
Spiller Address:	200 CORTLAND AVENUE
Spiller County:	001
Spiller Contact:	DAVID RYAN
Spiller Phone:	(315) 442-3325
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	190176
Latitude:	43.0363598
Longitude:	-76.1507518
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	OVERFLOW FROM VENT DURING FILLING. ONTO SOIL. HOWARD FROM SYRACUSE OFFICE NOTIFIED. SOIL TO BE CLEANED UP.

All Materials:

Site ID:	230781
Operable Unit ID:	1022909
Operable Unit:	01
Material ID:	362970
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Site ID:	230781
Operable Unit ID:	1022909
Operable Unit:	01
Material ID:	362971
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	5.00
Resource Affected:	Soil
Oxygenate:	Not reported

CBS:

CNY CENTRO INC. (Continued) **S103570665**

Name: CNY CENTRO INC.
Address: 200 CORTLAND AVE.
City,State,Zip: SYRACUSE, NY 13205
CBS Number: 7-000172
Program Type: CBS
Facility Status: Active
Expiration Date: 08/11/2024
Dec Region: 7
UTMX: 406071.56450
UTMY: 4765375.47900

SPILLS:
Name: CENTRAL BUS
Address: 200 CORTLAND AVE
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 0902638 / 2009-06-08
Facility ID: 0902638
Facility Type: ER
DER Facility ID: 363839
Site ID: 414692
DEC Region: 7
Spill Cause: Other
Spill Class: C3
SWIS: 3415
Spill Date: 2009-06-03
Investigator: MJROMOCK
Referred To: Not reported
Reported to Dept: 2009-06-04
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2009-06-04
Spill Record Last Update: 2009-06-08
Spiller Name: STEVE PROSONIC
Spiller Company: CNYRTA GARAGE
Spiller Address: 200 CORTLAND AVE
Spiller Company: 999
Contact Name: STEVE PROSONIC
Latitude: 43.0353013
Longitude: -76.1528976
DEC Memo: 06/04/09 -Inspected site. Solvent spilled when a parts cleaner cabinet that had been disposed of in
a dumpster tipped over. Some solvent had been inadvertenly left in the cabinet and leaked out.
Spill fell to the ground and paved area near the dumpster. Some blacktop was picked up along with
some contaminated soil. Environmental Products and Services is scheduled to pick up the excavated
material for disposal. 06/08/09 - Excavated material picked up from Centro Garage. Material was

CNY CENTRO INC. (Continued) **S103570665**

picked up by Environmental Products and Services. Rec'd copy of Dispoal documents. Closing file.

Remarks: CALLER STATES THAT THE PRODUCT WAS IN A DUMPSTER AND WHEN THE DUMPSTER WAS PICKED UP THE PRODUCT SPILLED TO SOIL AND PAVEMENT. CLEAN UP IS IN PROGRESS, SPILL IS CONTAINED.

All Materials:

Site ID:	414692
Operable Unit ID:	1171074
Operable Unit:	01
Material ID:	2162861
Material Code:	0014A
Material Name:	mineral/white spirits
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	8.00
Resource Affected:	Soil, Impervious Surface
Oxygenate:	Not reported

Name:	CENTRAL NY TRANSPORT AUTH
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1901686 / 2019-05-20
Facility ID:	1901686
Facility Type:	ER
DER Facility ID:	363839
Site ID:	588580
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2019-05-17
Investigator:	CXROSSI
Referred To:	Not reported
Reported to Dept:	2019-05-17
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	2019-05-17
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2019-05-17
Spill Record Last Update:	2019-05-20
Spiller Name:	NATHAN DOW
Spiller Company:	CENTRAL NY TRANSPORT AUTH
Spiller Address:	200 CORTLAND AVE
Spiller Company:	999
Contact Name:	NATHAN DOW
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported

CNY CENTRO INC. (Continued) **S103570665**

Remarks: loss to sewer and soil- c/u pending vac truck

All Materials:
Site ID: 588580
Operable Unit ID: 1336238
Operable Unit: 01
Material ID: 2345579
Material Code: 0015
Material Name: motor oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 10.00
Units: G
Recovered: 10.00
Resource Affected: Soil, Sewer
Oxygenate: Not reported

Name: CENTRO
Address: 200 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 0107608 / 2003-10-07
Facility ID: 0107608
Facility Type: ER
DER Facility ID: 190176
Site ID: 299297
DEC Region: 7
Spill Cause: Equipment Failure
Spill Class: C3
SWIS: 3415
Spill Date: 2001-10-22
Investigator: CFMANNES
Referred To: Not reported
Reported to Dept: 2001-10-25
CID: 257
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2001-10-25
Spill Record Last Update: 2003-10-07
Spiller Name: BOB PALLADINE
Spiller Company: CENTRO
Spiller Address: 200 CORTLAND AVE
Spiller Company: 001
Contact Name: BOB PALLADINE
Latitude: 43.0363598
Longitude: -76.1507518
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks: leaking lift

All Materials:
Site ID: 299297

CNY CENTRO INC. (Continued) **S103570665**

Operable Unit ID:	845718
Operable Unit:	01
Material ID:	532426
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	CENTRO GARAGE-CORTLAND AV
Address:	200 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9301095 / 1993-04-23
Facility ID:	9301095
Facility Type:	ER
DER Facility ID:	190176
Site ID:	299298
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D5
SWIS:	3415
Spill Date:	1993-04-22
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1993-04-22
CID:	Not reported
Water Affected:	ONON.CREEK
Spill Source:	Commercial Vehicle
Spill Notifier:	DEC
Cleanup Ceased:	1993-04-23
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	SYRACUSE LADDER AND SCFFO
Spiller Address:	621 HIAWATHA BLVD. WEST
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0363598
Longitude:	-76.1507518
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR
Remarks:	HYRAULIC LINE RUPTURED ON DELIVERY TRUCK IN CENTRO PARKING LOT. SPILL WAS NOT PROPERLY REPORTED NOR CLEANED UP.

All Materials:

Site ID:	299298
Operable Unit ID:	979699
Operable Unit:	01
Material ID:	401825

CNY CENTRO INC. (Continued) **S103570665**

Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	.00
Resource Affected:	Surface Water
Oxygenate:	Not reported

Name:	REGION TRANSIT AUTHORITY
Address:	200 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9702247 / 2002-08-06
Facility ID:	9702247
Facility Type:	ER
DER Facility ID:	190176
Site ID:	299299
DEC Region:	7
Spill Cause:	Other
Spill Class:	C3
SWIS:	3415
Spill Date:	1997-05-21
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1997-05-21
CID:	370
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1997-05-21
Spill Record Last Update:	2002-08-06
Spiller Name:	ABOVE
Spiller Company:	REGION TRANSIT AUTHORITY
Spiller Address:	200 CORTLAND AVE
Spiller Company:	001
Contact Name:	ABOVE
Latitude:	43.0363598
Longitude:	-76.1507518
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	REMOVING 5 TANKS SPILL FROM 4TH TANK 20 GALS SPILL TO GROUND AND MINIMAL TO GROUNDWATER ON SITE SPILL CONTAINED AND CLEANED

Name:	200 CORTLAND AVE
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1214613 / 2013-01-15
Facility ID:	1214613
Facility Type:	ER
DER Facility ID:	433182

CNY CENTRO INC. (Continued) **S103570665**

Site ID:	477861
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2013-01-15
Investigator:	cxrossi
Referred To:	Not reported
Reported to Dept:	2013-01-15
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Passenger Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2013-01-15
Spill Record Last Update:	2013-01-15
Spiller Name:	Not reported
Spiller Company:	PERSONAL VEHICLE
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	STEVE PROSONIC
Latitude:	43.0353013
Longitude:	-76.1528976
DEC Memo:	Not reported
Remarks:	15 qts - speedi dri in use

All Materials:

Site ID:	477861
Operable Unit ID:	1227659
Operable Unit:	01
Material ID:	2225102
Material Code:	0021
Material Name:	transmission fluid
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3.00
Units:	G
Recovered:	3.00
Resource Affected:	Impervious Surface
Oxygenate:	Not reported

Name:	BUS GARAGE
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2100002 / 2021-05-11
Facility ID:	2100002
Facility Type:	ER
DER Facility ID:	363839
Site ID:	617667
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3

CNY CENTRO INC. (Continued) **S103570665**

SWIS:	3415
Spill Date:	2021-04-01
Investigator:	DGMILLER
Referred To:	Not reported
Reported to Dept:	2021-04-01
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2021-04-01
Spill Record Last Update:	2021-05-11
Spiller Name:	Not reported
Spiller Company:	CNY RTA
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	NATHAN
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Spill cleaned up by miller environmental
Remarks:	cleanup pending - miller to pump out floor drain

All Materials:

Site ID:	617667
Operable Unit ID:	1364817
Operable Unit:	01
Material ID:	2377267
Material Code:	0043A
Material Name:	antifreeze
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	CNY BUS GARAGE
Address:	200 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0500747 / 2005-06-02
Facility ID:	0500747
Facility Type:	ER
DER Facility ID:	190176
Site ID:	343801
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	3415
Spill Date:	2005-04-15
Investigator:	MENASH
Referred To:	Not reported

CNY CENTRO INC. (Continued) **S103570665**

Reported to Dept:	2005-04-18
CID:	444
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2005-04-18
Spill Record Last Update:	2005-06-02
Spiller Name:	RAYMOND CROSSLEY
Spiller Company:	CNY BUS GARAGE
Spiller Address:	200 CORTLAND AVE
Spiller Company:	001
Contact Name:	RAYMOND CROSSLEY
Latitude:	43.0363630
Longitude:	-76.1507510
DEC Memo:	Not reported
Remarks:	LINES TO LIFTS ROTTED OUT: WILL START WORKING ON TOMORROW, TO LOCATE PROBLEM:

All Materials:

Site ID:	343801
Operable Unit ID:	1102480
Operable Unit:	01
Material ID:	582699
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	72.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	REPAIR BAYS 18 & 19
Address:	200 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0700048 / 2008-02-01
Facility ID:	0700048
Facility Type:	ER
DER Facility ID:	190176
Site ID:	379293
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D3
SWIS:	3415
Spill Date:	2007-04-02
Investigator:	kacahill
Referred To:	Not reported
Reported to Dept:	2007-04-02
CID:	408
Water Affected:	Not reported

CNY CENTRO INC. (Continued) **S103570665**

Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	2007-07-27
Cleanup Meets Std:	False
Last Inspection:	2007-05-17
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2007-04-02
Spill Record Last Update:	2008-02-01
Spiller Name:	DAVID RYAN
Spiller Company:	REPAIR BAYS 18 & 19
Spiller Address:	200 CORTLAND AVE
Spiller Company:	001
Contact Name:	DAVID RYAN
Latitude:	43.0353013
Longitude:	-76.1528976
DEC Memo:	Spoke to David Ryan. Source of spill is a leak in seals in hydraulic lift. Preventative maintenance conducted on 3/20 and 3/23 on this lift and seals were in tact at that time. On 3/30/07, they noticed that oil was down 40 gallons. They called in their contractor, Filtrec, and they tested the system today. They fixed the seals but the system is still leaking under the slab. They have hired C&S to retrofit all of the lifts. Onondaga Creek is about 500 feet from this facility. I indicated to Dave that he would need to collect confirmation samples and run for STARS and PCBs. He said he would call me once work is scheduled, estimated for next week. 4/12/07 Contacted Dave to get an update on the work. Since work will cost in excess of $15,000, it has to be approved by the board. The next board meeting is not until end of the month. 04/27/07 Spoke to Dave. The board approved the proposal. Work scheduled to beging week of May 7th. 05/17/07 Filtrec removed slab and pipe runs from oil pump to lift. Source of spill determined to be leak in one of the pipes. DEC inspected floor and piping. Filtrec will remove affected subgrade material, and new pump and piping will be installed. Centro plans to retrofit all lifts this year. Asked Dave Ryan for copy of the confirmation sampling analytical results and soil disposal receipts. 01/08/08 Contacted Dave Ryan to request confirmation sample results and disposal receipts so spill can be closed. 02/01/08 Received analytical results and disposal receipts. Closed spill.
Remarks:	NOT YET CLEANED; HAD SIMILAR LEAK IN JUNE OF 05’;

All Materials:

Site ID:	379293
Operable Unit ID:	1136783
Operable Unit:	01
Material ID:	2126736
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported

CNY CENTRO INC. (Continued) **S103570665**

Material FA:	Petroleum
Quantity:	40.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	GARAGE
Address:	200 CORTLAND AVE.
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0910008 / 2010-06-25
Facility ID:	0910008
Facility Type:	ER
DER Facility ID:	371679
Site ID:	422746
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	3415
Spill Date:	2009-12-09
Investigator:	MJROMOCK
Referred To:	Not reported
Reported to Dept:	2009-12-09
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-12-09
Spill Record Last Update:	2010-06-25
Spiller Name:	STEVE PROSONIC
Spiller Company:	CNY CENTRO
Spiller Address:	200 CORTLAND AVE.
Spiller Company:	999
Contact Name:	STEVE PROSONIC
Latitude:	43.0353013
Longitude:	-76.1528976
DEC Memo:	Lift removed from service . To be excavted and remediated in near future. 6/22/10 Rec'd closure documentation. Closing file.
Remarks:	UNDERGROUND HYDRAULIC LINE FAILURE, SPILL AMOUNT UNKNOWN AT THIS TIME, LEAKED MAINLY INTO GRAVEL UNDER BUILDING, CLEANUP PENDING FURTHER INVESTIGATION.

All Materials:

Site ID:	422746
Operable Unit ID:	1178574
Operable Unit:	01
Material ID:	2172031
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported

CNY CENTRO INC. (Continued) **S103570665**

Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	SYRACUSE CENTRO BUS
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0911732 / 2010-06-25
Facility ID:	0911732
Facility Type:	ER
DER Facility ID:	363839
Site ID:	424569
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	3415
Spill Date:	2010-02-03
Investigator:	MJROMOCK
Referred To:	Not reported
Reported to Dept:	2010-02-03
CID:	Not reported
Water Affected:	N/A
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2010-02-03
Spill Record Last Update:	2011-03-28
Spiller Name:	STEVE PROSONIC
Spiller Company:	SYRACUSE CENTRO BUS
Spiller Address:	200 CORTLAND AVE
Spiller Company:	999
Contact Name:	STEVE PROSONIC
Latitude:	43.0353013
Longitude:	-76.1528976
DEC Memo:	3/3/10 - Called CENTRO bus garage. Vehicle Lift in garage is leaking. The lift has been taken out of service. Repairs and cleanup to be effected in near future. CENTRO to call NYSDEC when work will be done. 03/25/2010 - Inspected site. Met with Dave Ryan of CENTRO Bus. leaking hydrualic system has been removed. Underground pipe has been excavted and soil samples collected from spill area after cleanup. Photos were taken. Closure report to be submitted by CENTRO. 6/22/10 - Rec'd closure documents. Closing file. 3/28/11 - Call from CENTRO garage. Excavation of this spill site underway. Exvation report to be submitted to NYSDEC.
Remarks:	DUE TO A BROKEN HYDRAULIC FLUID LINE ABOUT 12 GALLONS SPILLED TO

CNY CENTRO INC. (Continued) **S103570665**

SOIL. CLEAN UP PENDING.

All Materials:

Site ID:	424569
Operable Unit ID:	1180334
Operable Unit:	01
Material ID:	2174215
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	12.00
Units:	G
Recovered:	12.00
Resource Affected:	Soil
Oxygenate:	Not reported

Click this hyperlink while viewing on your computer to access
2 additional NY SPILL: record(s) in the EDR Site Report.

AIRS:

Name:	CNY CENTRO INC
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY 13205
DECID:	7311500050
Process ID:	Not reported
Latitude:	Not reported
Longitude:	Not reported
FIPS Code:	Not reported
Auth Type Code:	AFR
Permit Status:	Issued
Auth Status Code:	2
Emissions:	Not reported
Issue date:	07/31/2015
Expired Date:	07/31/2025
Emission Unit date:	Not reported
Contamination:	Not reported
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	Not reported
Permit Status:	Expired
Auth Status Code:	7
Emissions:	Not reported
Issue date:	11/29/2012
Expired Date:	07/31/2015
Emission Unit date:	Not reported
Contamination:	Not reported
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	Not reported
Permit Status:	Expired
Auth Status Code:	7
Emissions:	Not reported

CNY CENTRO INC. (Continued) **S103570665**

Issue date:	06/02/1999
Expired Date:	11/29/2012
Emission Unit date:	Not reported
Contamination:	Not reported
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	Not reported

AM155 **CENTRAL BUS CNYRTA MAIN GARAGE** **NY LTANKS** **S121997192**
SSW **200 CORTLAND AVE** **NY Spills** **N/A**
1/4-1/2 **SYRACUSE, NY 13202** **NY COOLING TOWERS**
0.425 mi.
2244 ft. **Site 2 of 2 in cluster AM**

Relative: **Lower**
Actual: **390 ft.**

LTANKS:

Name:	CENTRAL NY INC
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9213577 / 1995-12-28
Facility ID:	9213577
Site ID:	275090
Spill Date:	1993-03-09
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	E6
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	BFMATTHE
Referred To:	Not reported
Reported to Dept:	1993-03-09
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1993-03-11
Spill Record Last Update:	1995-12-28
Spiller Name:	Not reported
Spiller Company:	CENTRAL NY INC
Spiller Address:	2OO CORTLAND AVE
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	363839
Latitude:	43.0290089
Longitude:	-76.1573480
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BM 03/12/93: MR DAVID RYAN CONTACTED DEC ON3-12-93 AND STATED THAT THE TANK WAS RETESTED AND IT PASSED.
Remarks:	TANK TEST FAILURE CLEMENT WILL RETEST

All Materials:

Site ID:	275090

CENTRAL BUS CNYRTA MAIN GARAGE (Continued) **S121997192**

Operable Unit ID:	980879
Operable Unit:	01
Material ID:	403348
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

SPILLS:

Name:	CENTRAL BUS CNYRTA MAIN GARAGE
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	2106666 / 2022-01-14
Facility ID:	2106666
Facility Type:	ER
DER Facility ID:	353019
Site ID:	625565
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2021-10-15
Investigator:	CFNORRIS
Referred To:	Not reported
Reported to Dept:	2021-10-15
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	2021-10-15
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2021-10-15
Spill Record Last Update:	2022-01-14
Spiller Name:	NATHAN DOW
Spiller Company:	CENTRAL BUS CNYRTA
Spiller Address:	200 CORTLAND AVE
Spiller Company:	999
Contact Name:	NATHAN DOW
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	RP WILL MANAGE EXCAVATION AND SAMPLING. SEVERAL SPILL AREAS IN SOIL OFF TARVIA AT GARAGE.
Remarks:	No drains impacted. 10-15 Gallons lost, c/u pending

All Materials:

Site ID:	625565
Operable Unit ID:	1372706

CENTRAL BUS CNYRTA MAIN GARAGE (Continued) **S121997192**

Operable Unit:	01
Material ID:	2386052
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	15.00
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	CENTRO OF SYRACUSE
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2107306 / 2021-11-08
Facility ID:	2107306
Facility Type:	ER
DER Facility ID:	363839
Site ID:	628220
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2021-11-08
Investigator:	DJLASALL
Referred To:	Not reported
Reported to Dept:	2021-11-08
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2021-11-08
Spill Record Last Update:	2021-11-08
Spiller Name:	Not reported
Spiller Company:	CENTRO OF SYRACUSE
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	NATHAN
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	spill cleaned up by Centro. NFA
Remarks:	cleanup in progress

All Materials:

Site ID:	628220
Operable Unit ID:	1375346
Operable Unit:	01
Material ID:	2388804
Material Code:	0043A
Material Name:	antifreeze

CENTRAL BUS CNYRTA MAIN GARAGE (Continued) **S121997192**

Case No.:	Not reported
Material FA:	Other
Quantity:	1.00
Units:	G
Recovered:	1.00
Resource Affected:	Impervious Surface
Oxygenate:	Not reported

Name:	COMMERCIAL/INDUSTRIAL
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2306995 / 2023-11-22
Facility ID:	2306995
Facility Type:	ER
DER Facility ID:	363839
Site ID:	659026
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2023-11-20
Investigator:	DJLASALL
Referred To:	Not reported
Reported to Dept:	2023-11-20
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2023-11-20
Spill Record Last Update:	2023-11-22
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	200 CORTLAND AVE
Spiller Company:	999
Contact Name:	CLAIRE DEL SATTI
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Petroleum contaminated soil encountered during excavation for utility conduit. PID readings of around 80 ppm noted. Approximately one yard or less of impacted soil segregated for sampling and disposal. Advised caller to treat any further impacted soil encountered within the excavation area in the same manner. NFA
Remarks:	Petroleum contamination, cleanup pending

All Materials:

Site ID:	659026
Operable Unit ID:	1405877
Operable Unit:	01
Material ID:	2423200

CENTRAL BUS CNYRTA MAIN GARAGE (Continued) **S121997192**

Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

COOLING TOWERS:

Name:	Not reported
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY 13202
Equipment Unique ID:	7749
Equipment Borough:	Not reported
Intended Use:	Air Conditioning
Manufacturer:	BAC
Model:	VF1-036-21L/X
Cooling Capacity:	85
Cooling Capacity Unit:	Tonnage
Commissioned Date:	08/10/2001
Inspection Date:	05/04/2022
Date of Bacteriological Collection:	06/06/2022
Date of Legionella Collection:	02/01/2024
Last Legionella Result > 1,000 CFU/mL:	lt20
Last Sampled Days:	Not reported
Reg Compliant:	Not reported
Last Update Days:	Not reported
CT Status:	Not reported
Equipment Tower Operation Duration:	Not reported
Latitude:	43.036343
Longitude:	-76.150772

AL156 **SYRACUSE UNIV** **NY LTANKS** **S105997874**
ESE **900 IRVING AVE** **NY Spills** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.428 mi.
2262 ft. **Site 2 of 2 in cluster AL**

Relative:
Higher

Actual:
497 ft.

LTANKS:

Name:	SYRACUSE CARRIER DOME
Address:	900 IRVING AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0210237 / 2003-10-31
Facility ID:	0210237
Site ID:	96874
Spill Date:	2003-01-10
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2003-01-10

SYRACUSE UNIV (Continued) **S105997874**

CID:	281
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2003-01-10
Spill Record Last Update:	2003-10-31
Spiller Name:	CATHY STRICKLAND
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	SAME
Spiller County:	001
Spiller Contact:	CATHY STRICKLAND
Spiller Phone:	(607) 756-4253
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	243755
Latitude:	43.0375850
Longitude:	-76.1383160
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	TANK TEST FAILURE AT ABOVE LOCATION. REPLACE MANWAY LID AND RESTEST.

All TTF:

Facility ID:	0210237
Spill Number:	0210237
Spill Tank Test:	1527928
Site ID:	96874
Tank Number:	Not reported
Tank Size:	0
Material:	Not reported
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

Facility ID:	0210237
Spill Number:	0210237
Spill Tank Test:	1527929
Site ID:	96874
Tank Number:	UNK
Tank Size:	3000
Material:	Not reported
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	F

SYRACUSE UNIV (Continued) **S105997874**

Modified By: Spills
Last Modified Date: Not reported

All Materials:
Site ID: 96874
Operable Unit ID: 861489
Operable Unit: 01
Material ID: 513627
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Resource Affected: Soil
Oxygenate: Not reported

SPILLS:
Name: SYRACUSE UNIV
Address: 900 IRVING AVE
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 0300735 / 2003-04-22
Facility ID: 0300735
Facility Type: ER
DER Facility ID: 243755
Site ID: 301633
DEC Region: 7
Spill Cause: Equipment Failure
Spill Class: C3
SWIS: 3415
Spill Date: 2003-04-21
Investigator: CFMANNES
Referred To: Not reported
Reported to Dept: 2003-04-21
CID: 207
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2003-04-21
Spill Record Last Update: 2003-04-22
Spiller Name: HEATHER BADGER
Spiller Company: SYRACUSE UNIV AMBULANCE
Spiller Address: 900 IRVING AVE
Spiller Company: 001
Contact Name: JIM MCCUMBER
Latitude: 43.0375917
Longitude: -76.1383269
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM

SYRACUSE UNIV (Continued) **S105997874**

Remarks: cleanup complete

All Materials:
Site ID: 301633
Operable Unit ID: 868899
Operable Unit: 01
Material ID: 508807
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 9.00
Units: G
Recovered: 9.00
Resource Affected: Sewer
Oxygenate: Not reported

AN157 **SPILL NUMBER 9908209** **NY LTANKS** **S104620529**
West **377 WEST ONONDAGA ST** **NY Spills** **N/A**
1/4-1/2 **SYRACUSE, NY** **NY MANIFEST**
0.431 mi.
2278 ft. **Site 1 of 3 in cluster AN**

Relative: **Lower**
Actual: **390 ft.**

LTANKS:
Name: SPILL NUMBER 9908209
Address: 377 WEST ONONDAGA ST
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 9908209 / 2000-01-31
Facility ID: 9908209
Site ID: 153747
Spill Date: 1999-10-06
Spill Cause: Tank Failure
Spill Source: Private Dwelling
Spill Class: C3
Cleanup Ceased: Not reported
SWIS: 3415
Investigator: CFMANNES
Referred To: Not reported
Reported to Dept: 1999-10-06
CID: 211
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1999-10-06
Spill Record Last Update: 2002-06-03
Spiller Name: ERIC MURDOCH
Spiller Company: Not reported
Spiller Address: 377 WEST ONONDAGA ST
Spiller County: 001
Spiller Contact: ERIC MURDOCH
Spiller Phone: (315) 478-2374
Spiller Extention: Not reported
DEC Region: 7

SPILL NUMBER 9908209 (Continued) **S104620529**

DER Facility ID: 130418
Latitude: 43.0417211
Longitude: -76.1557750
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks: caller was doing test pit excavation when he discovered 2 1000 ust there is approx 100 ton of contaminated soil - site is apartment complex

All Materials:
Site ID: 153747
Operable Unit ID: 1082505
Operable Unit: 01
Material ID: 300884
Material Code: 0012A
Material Name: kerosene
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Resource Affected: Soil
Oxygenate: Not reported

SPILLS:
Name: ELEVATOR SHAFT
Address: 377 WEST ONONDAGA ST
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 8802511 / 1991-06-10
Facility ID: 8802511
Facility Type: ER
DER Facility ID: 130418
Site ID: 277682
DEC Region: 7
Spill Cause: Unknown
Spill Class: Not reported
SWIS: 3415
Spill Date: 1988-06-16
Investigator: VOLLMER
Referred To: Not reported
Reported to Dept: 1988-06-17
CID: Not reported
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Health Department
Cleanup Ceased: 1991-03-20
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: True
Remediation Phase: 0
Date Entered In Computer: 1988-06-28
Spill Record Last Update: 1993-07-13
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller Company: 999

SPILL NUMBER 9908209 (Continued) **S104620529**

Contact Name: Not reported
Latitude: 43.0417211
Longitude: -76.1557750
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was DV
06/17/88: ENVIRONMENTAL OIL
HIRED BY OWNER TO PUMP & VENTILATE SHAFT. SUSPECT TANKS AT SAUNDERS BLDG. 06/18/88: FOUND GASOLINE
AND WASTE OIL TANK, BOTH WITH FREE PRODUCT, IN SAUNDERS BLDG. TOOK SAMPLE FROM GAS TANK. 06/20/88:
HIRE OBG TO CROSS MATCH SAMPLES. UST @ SAUNDERS BLDG. & ELEVATOR SHAFT. 07/14/88: 4 TANKS FOUND AT
REAR OFF 377 W. ONONDAGA ST. ENVIRONMENTAL OIL ATTEMTING TO OPEN AND SAMPLE. 07/19/88: 3 TANKS
TURNED OUT NOT TO BE TANKS. SOIL GAS ANALYSIS PLANNED. 07/29/88: ENV. OIL ON SITE TO DO SOIL GAS
ANALYSIS. 08/02/88: JOE MELITO - INSPECTER. HOT SPOT FOUND UNDER AND AROUND STAIRWAY BY THE
ELEVATOR SHAFT. NO SOURCE FOUND YET. AREA BEHIND BUILDING CLEAN. 08/10/88: ELEVATOR SHAFT WILL BE
PUMPED DOWN DAILY COMMENCING 08/15/88. 08/15/88: PUMPING WATER FROM ELEVATOR SHAFT DAILY. 08/19/88:
RECOVERY ON GOING. FREE PRODUCT CONTINUES TO BE PULLED IN. 08/26/88: FREE PRODUCT AND VAPORS
DECREASING. CONTINUE PUMPING FOR ONE MORE WEEK. 10/07/88: ELEVATOR SHAFT CASSON WILL BE INSTALLED
ASAP. THAN SHAFT WILL BE SEALED ABOVE GROUNDWATER. DEC WILL THEN INSTALL SOIL VENTING SYSTEM.
11/23/88: AWAITING ACTION BY BLDG OWNER PRIOR TO INSTALLING SOIL VENTING SYSTEM. 12/08/88: DUG OUT
BOTTOM OF ELEV SHAFT. DEC WIL PUMP DURING ELEVATOR DRILLING THEN INSTALL VAPOR EXTRACTION SYS.
04/10/89: CITY HAS ISSUED PERMIT TO MIDSTATE ELEVATOR. CONSTRUCTION TO START SOON. 04/19/89: VPAPOR
RECOVERY SYSTEM INPLACE. AWAITING ELEV CO TO INSTALL SHAFT. 05/08/89: CITY ISSUED STOP WORK ORDER.
06/01/89: INSPECTION-DUAL FANS- 1/40 HP.INLET CONC=33 PPM, OUTLET 2 PPM. 08/23/89: INSPECTION-INLET
CONC=25 PPM, OUTLET 3 PPM. 04/23/91: SYSTEM REMOVED FROM BUILDING NO MORE PROBLEMS TO DATE.
Remarks: GASOLINE IN BOTTOM OF ELEVATOR SHAFT ON GROUNDWATER. FIRE DEPT. & HEALTH DEPT. ON SCENE.

All Materials:
Site ID: 277682
Operable Unit ID: 919726
Operable Unit: 01
Material ID: 458075
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: Not reported
Recovered: 100.00
Resource Affected: Groundwater
Oxygenate: Not reported

SPILL NUMBER 9908209 (Continued) **S104620529**

Name:	BACKYARD OF APT BLDG
Address:	377 WEST ONONDAGA ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9814460 / 2002-08-06
Facility ID:	9814460
Facility Type:	ER
DER Facility ID:	130418
Site ID:	153746
DEC Region:	7
Spill Cause:	Deliberate
Spill Class:	C3
SWIS:	3415
Spill Date:	1998-09-01
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1999-03-03
CID:	365
Water Affected:	Not reported
Spill Source:	Private Dwelling
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1999-03-03
Spill Record Last Update:	2002-08-06
Spiller Name:	FROM APT ON 4TH FLOOR
Spiller Company:	BACKYARD OF APT BLDG
Spiller Address:	377 WEST ONONDAGA ST
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0417211
Longitude:	-76.1557750
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM 3/4/99 Lt Yakel said CO would handle.
Remarks:	subj from 4th floor takes antifreeze out of cars and dumps it onto ground - cars are in the back yard - on going problem - creek near by (onondaga creek 150 ft to back)

All Materials:

Site ID:	153746
Operable Unit ID:	1075503
Operable Unit:	01
Material ID:	311149
Material Code:	0043A
Material Name:	antifreeze
Case No.:	Not reported
Material FA:	Other
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported
Site ID:	153746

SPILL NUMBER 9908209 (Continued) **S104620529**

Operable Unit ID:	1075503
Operable Unit:	01
Material ID:	311148
Material Code:	0015
Material Name:	motor oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

NY MANIFEST:

EPA ID:	NYP000884700
Country:	USA
Name:	NYSDEC
Address:	377 WEST ONONDAGA ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY
Zip 4:	Not reported
Location Address 1:	377 WEST ONONDAGA ST
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	NYSDEC
Mailing Contact:	NYSDEC
Mailing Address 1:	50 WOLF ROAD
Mailing Address 2:	Not reported
Mailing City,State,Zip:	ALBANY, NY 12233
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	8004577362

Manifest Data:

Document ID:	NYA7237161
Manifest Status:	C - Completed copy
Trans1 State ID:	000000000
Year:	1989
Trans2 State ID:	000000000
Generator Ship Date:	890614
Trans1 Recv Date:	890614
Trans2 Recv Date:	890616
TSD Site Recv Date:	890616
Part A Recv Date:	890629
Part B Recv Date:	890622
Generator EPA ID:	NYP000884700
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	NYD980761191
TSDF ID 1:	NYD043815703
TSDF ID 2:	Not reported

SPILL NUMBER 9908209 (Continued) **S104620529**

Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	02000
Units:	Pounds
Number of Containers:	003
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	100

Document ID:	NYA7236531
Manifest Status:	C - Completed copy
Trans1 State ID:	LIC#DG202
Year:	1989
Trans2 State ID:	Not reported
Generator Ship Date:	890119
Trans1 Recv Date:	890119
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	890120
Part A Recv Date:	890127
Part B Recv Date:	890127
Generator EPA ID:	NYP000884700
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD043815703
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	IGNITABLE WASTE
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported

SPILL NUMBER 9908209 (Continued) **S104620529**

Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	02600
Units:	Pounds
Number of Containers:	004
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	100

AN158 **ELEVATOR SHAFT** **UST FINDER RELEASE** **1029058906**
West **377 WEST ONONDAGA ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.431 mi.
2278 ft. **Site 2 of 3 in cluster AN**

Relative: **Lower**

Actual: **390 ft.**

UST FINDER RELEASE:

Object ID:	249430
Facility ID:	NY130418
Lust ID:	NY8802511
Name:	ELEVATOR SHAFT
Address:	377 WEST ONONDAGA ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1988/06/16 16:00:00+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1314
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1557799999999
Y Coord:	43.0417200000001
Latitude:	43.0417199999999
Longitude:	-76.1557799999999

AN159 **SPILL NUMBER 9908209** **UST FINDER RELEASE** **1029058907**
West **377 WEST ONONDAGA ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.431 mi.
2278 ft. **Site 3 of 3 in cluster AN**

Relative: **Lower**
Actual: **390 ft.**

UST FINDER RELEASE:

Object ID:	249431
Facility ID:	NY130418
Lust ID:	NY9908209
Name:	SPILL NUMBER 9908209
Address:	377 WEST ONONDAGA ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1999/10/06 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1314
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1557799999999
Y Coord:	43.0417200000001
Latitude:	43.0417199999999
Longitude:	-76.1557799999999

AO160 **FORMER ACCURATE DIE SITE** **NY LTANKS** **S101508795**
NNE **547 EAST GENESEE STREET** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.441 mi.
2326 ft. **Site 1 of 2 in cluster AO**

Relative: **Higher**
Actual: **400 ft.**

LTANKS:

Name:	FORMER ACCURATE DIE SITE
Address:	547 EAST GENESEE STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9416408 / 1996-01-01
Facility ID:	9416408
Site ID:	129682
Spill Date:	1995-03-20
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial

FORMER ACCURATE DIE SITE (Continued) **S101508795**

Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1995-03-20
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1995-04-11
Spill Record Last Update:	1996-12-04
Spiller Name:	Not reported
Spiller Company:	FORMER ACCURATE DIE SITE
Spiller Address:	547 EAST GENESEE STREET
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	111787
Latitude:	43.0478469
Longitude:	-76.1447784
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	ABANDONED SINCE 1988. TANK BEING REMOVED. BOTTOM ALL RUESTED OUT AND SOILS STAINED.

All Materials:

Site ID:	129682
Operable Unit ID:	1013632
Operable Unit:	01
Material ID:	371569
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

AO161 **FORMER ACCURATE DIE SITE** **UST FINDER RELEASE** **1029057463**
NNE **547 EAST GENESEE STREET** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.441 mi.
2326 ft. **Site 2 of 2 in cluster AO**

Relative:
Higher

Actual:
400 ft.

UST FINDER RELEASE:

Object ID:	249522
Facility ID:	NY111787
Lust ID:	NY9416408
Name:	FORMER ACCURATE DIE SITE

FORMER ACCURATE DIE SITE (Continued) **1029057463**

Address:	547 EAST GENESEE STREET
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1995/03/20 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1477
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.14478
Y Coord:	43.04785
Latitude:	43.0478499999999
Longitude:	-76.1447799999999

162
NNE
1/4-1/2
0.445 mi.
2347 ft.

MARKS HOTEL **NY LTANKS** **S105996021**
ALMOND/E GENESSE ST **N/A**
SYRACUSE, NY

Relative:
Higher

Actual:
403 ft.

LTANKS:

Name:	MARKS HOTEL
Address:	ALMOND/E GENESSE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0202485 / 2002-09-09
Facility ID:	0202485
Site ID:	220960
Spill Date:	2002-06-07
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2002-06-07
CID:	396
Water Affected:	Not reported
Spill Notifier:	Other

MARKS HOTEL (Continued) **S105996021**

Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	2002-06-07
Spill Record Last Update:	2004-01-23
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller County:	999
Spiller Contact:	GENE HICKS
Spiller Phone:	(315) 488-4836
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	182758
Latitude:	43.0480780
Longitude:	-76.1577830
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	while doing a tank pull cont soil was found...tank has a hole in the bottom of it.

All TTF:

Facility ID:	0202485
Spill Number:	0202485
Spill Tank Test:	1527187
Site ID:	220960
Tank Number:	Not reported
Tank Size:	0
Material:	0008
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	220960
Operable Unit ID:	855588
Operable Unit:	01
Material ID:	520336
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

163
North
1/4-1/2
0.486 mi.
2568 ft.

N.Y. TELE. - FAYETTE ST.
FAYETTE ST & STATE ST
SYRACUSE, NY

NY LTANKS **S100129513**
NY Spills **N/A**

Relative:
Higher

Actual:
399 ft.

LTANKS:

Name:	N.Y. TELE. - FAYETTE ST.
Address:	FAYETTE ST & STATE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8605899 / 1989-12-31
Facility ID:	8605899
Site ID:	313598
Spill Date:	1986-12-16
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Cleanup Ceased:	1987-01-31
SWIS:	3415
Investigator:	VOLLMER
Referred To:	Not reported
Reported to Dept:	1986-12-16
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1987-01-05
Spill Record Last Update:	1993-11-19
Spiller Name:	Not reported
Spiller Company:	N.Y. TELEPHONE
Spiller Address:	FAYETTE & STATE STREETS
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	252846
Latitude:	43.0486179
Longitude:	-76.1474178
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was DV / / : SAMPLE TAKEN TO CONFIM PCB CONTAMIATION AT NYTEL TANK SITE. / / : ENVIR. OIL WAS HIRED ON 12/19/86.
Remarks:	REMOVING OLD OIL TANK. CRAIG BUTLER OF OBRIEN & GERE WAS CALLER.

All Materials:

Site ID:	313598
Operable Unit ID:	902744
Operable Unit:	01
Material ID:	475049
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00

N.Y. TELE. - FAYETTE ST. (Continued) **S100129513**

Resource Affected:	Groundwater
Oxygenate:	Not reported

SPILLS:

Name:	SO SALINA ST
Address:	FAYETTE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9611398 / 1996-12-17
Facility ID:	9611398
Facility Type:	ER
DER Facility ID:	283130
Site ID:	174906
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D5
SWIS:	3400
Spill Date:	1996-12-16
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1996-12-16
CID:	211
Water Affected:	Not reported
Spill Source:	Passenger Vehicle
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1996-12-16
Spill Record Last Update:	1996-12-17
Spiller Name:	JOHN RENOCK
Spiller Company:	CENTRO
Spiller Address:	200 CORTLAND AV
Spiller Company:	001
Contact Name:	JOHN RENOCK
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	transmission line blew on bus causing product to spill over 3 block area - dpw was on scene sanded roadway and swept it up

All Materials:

Site ID:	174906
Operable Unit ID:	1042841
Operable Unit:	01
Material ID:	563917
Material Code:	0021
Material Name:	transmission fluid
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	5.00
Resource Affected:	Soil

N.Y. TELE. - FAYETTE ST. (Continued) **S100129513**

Oxygenate: Not reported

AP164 **CASTLE REST NURSING HOME** **NY LTANKS** **S104620147**
South **116 EAST CASTLE ST** **NY Spills** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.488 mi.
2578 ft. **Site 1 of 2 in cluster AP**

Relative:
Higher

Actual:
402 ft.

LTANKS:

Name:	SPILL NUMBER 9900884
Address:	116 EAST CASTLE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9900884 / 2000-03-20
Facility ID:	9900884
Site ID:	166430
Spill Date:	1999-04-23
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1999-04-23
CID:	504
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1999-04-23
Spill Record Last Update:	2002-06-03
Spiller Name:	Not reported
Spiller Company:	HOWARD NURSING HM
Spiller Address:	116 EAST CASTLE ST
Spiller County:	001
Spiller Contact:	CALLER
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	140221
Latitude:	43.0330781
Longitude:	-76.1484564
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
	BM WENT TO TANK PULL, CM TOOK OVER SITE
Remarks:	PULLED TANK, FOUND CONTAMINATION.

All Materials:

Site ID:	166430
Operable Unit ID:	1075649
Operable Unit:	01
Material ID:	308001
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported

CASTLE REST NURSING HOME (Continued) **S104620147**

Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

SPILLS:

Name:	CASTLE REST NURSING HOME
Address:	116 EAST CASTLE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9711111 / 1998-01-06
Facility ID:	9711111
Facility Type:	ER
DER Facility ID:	140221
Site ID:	166429
DEC Region:	7
Spill Cause:	Other
Spill Class:	C3
SWIS:	3415
Spill Date:	1998-01-05
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1998-01-05
CID:	351
Water Affected:	Not reported
Spill Source:	Tank Truck
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1998-01-05
Spill Record Last Update:	1998-01-05
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	KEVIN KUTZSCHER
Latitude:	43.0330781
Longitude:	-76.1484564
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM 01/05/98 ON SITE: GRIFFEN INDUSDTRIAL SERVICES ON SITE FOR CLEAN UP, OVER FILL LOSS THROUGH VENT PIPE, STAIN ON BRICKWALL AND GRASSY AREA DOWN BELOW, DEBRIS AND SOIL DRUMMED UP AND DISPOSED.
Remarks:	CALLER STATES THAT THE NURSING HOME OVER ORDERED FUEL AND THAT THERE IS NO WAY TO GAUGE THE TANK TO MEASURE THE AMOUNT OF FUEL IN IT

AP165
South
1/4-1/2
0.488 mi.
2578 ft.

SPILL NUMBER 9900884
116 EAST CASTLE ST
SYRACUSE, NY 0

Site 2 of 2 in cluster AP

UST FINDER RELEASE | **1029059726** | **N/A**

Relative:
Higher

Actual:
402 ft.

UST FINDER RELEASE:

Object ID:	249470
Facility ID:	NY140221
Lust ID:	NY9900884
Name:	SPILL NUMBER 9900884
Address:	116 EAST CASTLE ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1999/04/23 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1855
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1484599999999
Y Coord:	43.03308
Latitude:	43.0330799999999
Longitude:	-76.14846

166
NNE
1/4-1/2
0.490 mi.
2587 ft.

SPILL NUMBER 9710355
713 EAST GENESEE ST
SYRACUSE, NY

NY LTANKS | **S104646512**
NY Spills | **N/A**

Relative:
Higher

Actual:
404 ft.

LTANKS:

Name:	SPILL NUMBER 9703897
Address:	713 EAST GENESEE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9703897 / 2001-02-12
Facility ID:	9703897
Site ID:	167465
Spill Date:	1997-06-30
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other

SPILL NUMBER 9710355 (Continued) **S104646512**

Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1997-06-30
CID:	369
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1997-06-30
Spill Record Last Update:	2001-02-12
Spiller Name:	NORN SWANSON
Spiller Company:	NORM SWANSON
Spiller Address:	1030 E GENESSEE ST
Spiller County:	001
Spiller Contact:	MIKE MATTO
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	110047
Latitude:	43.0474617
Longitude:	-76.1418736
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	tank passed test- contaminated soil found dec on site-tank no longer in service-overfill suspected

SPILLS:

Name:	SPILL NUMBER 9710355
Address:	713 EAST GENESEE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9710355 / 1997-12-12
Facility ID:	9710355
Facility Type:	ER
DER Facility ID:	110047
Site ID:	127428
DEC Region:	7
Spill Cause:	Other
Spill Class:	C3
SWIS:	3415
Spill Date:	1997-06-30
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1997-10-28
CID:	211
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False

SPILL NUMBER 9710355 (Continued) **S104646512**

Remediation Phase:	0
Date Entered In Computer:	1997-12-09
Spill Record Last Update:	1997-12-09
Spiller Name:	NORM SWANSON
Spiller Company:	THE WOODBINE GROUP INC
Spiller Address:	1030 EAST GENESSEE ST
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0474617
Longitude:	-76.1418736
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	TANK REMOVAL - SOIL RESULTS INDICATE PETROLEUM CONTAMINATION TANK #7-600555

167
SW
1/2-1
0.734 mi.
3874 ft.

FORMER BROWN MANUFACTURING SITE
101 CHESTER STREET
SYRACUSE, NY 13207

NY SHWS **S105859104**
NY ENG CONTROLS **N/A**
NY INST CONTROL
NY ERP
NY MANIFEST

Relative:
Lower

Actual:
390 ft.

SHWS:

Name:	FORMER BROWN MANUFACTURING SITE
Address:	101 CHESTER STREET
City,State,Zip:	SYRACUSE, NY 13207
Program:	HW
Site Code:	465076
Classification:	C
Region:	7
Acres:	0.800
HW Code:	734141
Record Add:	06/07/2012
Record Upd:	01/07/2021
Updated By:	JPCOOK
Site Description:	"See Site # B00024."
Env Problem:	"See Site # B00024."
Health Problem:	""
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2012-06-11 10:46:00
Record Upd:	2016-06-15 11:38:00
Updated By:	JPCOOK
Own Op:	1
Sub Type:	C01
Owner Name:	Owen Kerney
Owner Company:	City of Syracuse TD
Owner Address:	201 E. Washington St, Suite 5000
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	734141
Waste Type:	CHROMIUM

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	BENZO(B)FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	BARIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	SELENIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	Chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	DIBENZ[A,H]ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	LEAD
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	indeno(1,2,3-cd)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	ARSENIC
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	BENZ(A)ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	BENZO(A)PYRENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	CADMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	COPPER
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	benzo(a)anthracene
Waste Quantity:	UNKNOWN

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Waste Code: Not reported
HW Code: 734141
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734141
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734141
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: Not reported
Cross Ref Type Code: Not reported
Cross Ref Type: Not reported
Record Added Date: Not reported
Record Updated: Not reported
Updated By: Not reported

ENG CONTROLS:
Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
HW Code: B00024
Control Code: 15
Control Type: ENG
Date Record Added: 06/11/2012
Date Rec Updated: 10/27/2022
Updated By: GWPRISCO
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."

Env Problem:	"Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."
Health Problem:	"Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
	Not reported
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	43:02:00. / 76:09:28.
Dell:	False
Record Add:	2003-10-28 13:52:00
Record Upd:	2012-10-04 14:34:00
Updated By:	ldennist
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Local History & Genealogy Department
Owner Company:	Onondaga County Public Library
Owner Address:	The Galleries of Syracuse
Owner Addr2:	447 South Salina Street
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	C01
Owner Name:	Ben Walsh
Owner Company:	City of Syracuse
Owner Address:	203 City Hall
Owner Addr2:	233 E Washington Street
Owner City,St,Zip:	SYRACUSE (C), NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	C01
Owner Name:	Not reported
Owner Company:	City of Syracuse
Owner Address:	203 City Hall, 233 E Washington St
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Joshua Cook
Owner Company:	NYSDEC Region 7
Owner Address:	615 Erie Blvd West
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13204
Owner Country:	United States of America
HW Code:	B00024
Waste Type:	benzo(k)fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	PHENANTHRENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	PYRENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	SELENIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	BENZ(A)ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	BENZO(B)FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	Chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	ARSENIC
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	CADMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	DIBENZ[A,H]ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	LEAD
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Waste Type:	NICKEL
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	NAPHTHALENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	BENZO[K]FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	BENZO(A)PYRENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	COPPER
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	BARIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	CHROMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	indeno(1,2,3-cd)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	Petroleum Products
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	BENZO(A)ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	NYR000223016
Cross Ref Type Code:	06
Cross Ref Type:	RCRA EPA ID No.
Record Added Date:	2015-11-13 13:18:00
Record Updated:	2015-11-13 13:18:00
Updated By:	JPCOOK
Crossref ID:	7-601599
Cross Ref Type Code:	18
Cross Ref Type:	PBS No.
Record Added Date:	2017-01-03 13:17:00
Record Updated:	2017-01-03 13:17:00
Updated By:	JPCOOK
Crossref ID:	NYWII-B00024-12-14
Cross Ref Type Code:	23

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2018-03-06 11:54:00
Record Updated:	2018-03-06 11:54:00
Updated By:	JPCOOK
Crossref ID:	C300654
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2018-03-06 11:55:00
Record Updated:	2018-03-06 11:55:00
Updated By:	JPCOOK
Crossref ID:	B 5431 P 745
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2017-07-28 13:09:00
Record Updated:	2017-07-28 13:09:00
Updated By:	JPCOOK

INST CONTROL:

Name:	FORMER BROWN MANUFACTURING SITE
Address:	101 CHESTER STREET
City,State,Zip:	SYRACUSE, NY 13207
Site Code:	57206
Control Name:	Landuse Restriction
HW Code:	B00024
Control Code:	25
Control Type:	INST
Dt record added:	06/11/2012
Dt rec updated:	10/27/2022
Updated By:	GWPRISCO
Site Code:	57206
Site Description:	"Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy,

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."

Env Problem: "Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."

Health Problem: "Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
Not reported
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 43:02:00. / 76:09:28.
Dell: False
Record Add: 2003-10-28 13:52:00
Record Upd: 2012-10-04 14:34:00
Updated By: ldennist
Own Op: Document Repository
Sub Type: NNN
Owner Name: Local History & Genealogy Department
Owner Company: Onondaga County Public Library
Owner Address: The Galleries of Syracuse
Owner Addr2: 447 South Salina Street
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Ben Walsh
Owner Company: City of Syracuse
Owner Address: 203 City Hall
Owner Addr2: 233 E Washington Street
Owner City,St,Zip: SYRACUSE (C), NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: C01
Owner Name: Not reported
Owner Company: City of Syracuse
Owner Address: 203 City Hall, 233 E Washington St
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Sub Type: NNN
Owner Name: Joshua Cook
Owner Company: NYSDEC Region 7
Owner Address: 615 Erie Blvd West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13204
Owner Country: United States of America
HW Code: B00024
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00
Updated By: JPCOOK
Crossref ID: C300654
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00
Updated By: JPCOOK
Crossref ID: B 5431 P 745
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Control Name: Ground Water Use Restriction
HW Code: B00024
Control Code: 08
Control Type: INST
Dt record added: 06/11/2012
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57206
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand.

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

	The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."
Env Problem:	"Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."
Health Problem:	"Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
	Not reported
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	43:02:00. / 76:09:28.
Dell:	False
Record Add:	2003-10-28 13:52:00
Record Upd:	2012-10-04 14:34:00
Updated By:	ldennist
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Local History & Genealogy Department
Owner Company:	Onondaga County Public Library
Owner Address:	The Galleries of Syracuse
Owner Addr2:	447 South Salina Street
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	C01
Owner Name:	Ben Walsh
Owner Company:	City of Syracuse
Owner Address:	203 City Hall
Owner Addr2:	233 E Washington Street
Owner City,St,Zip:	SYRACUSE (C), NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	C01
Owner Name:	Not reported
Owner Company:	City of Syracuse
Owner Address:	203 City Hall, 233 E Washington St
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Joshua Cook

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Owner Company: NYSDEC Region 7
Owner Address: 615 Erie Blvd West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13204
Owner Country: United States of America
HW Code: B00024
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

HW Code: B00024
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Updated By: JPCOOK
Crossref ID: C300654
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00
Updated By: JPCOOK
Crossref ID: B 5431 P 745
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Control Name: Soil Management Plan
HW Code: B00024
Control Code: 14
Control Type: INST
Dt record added: 06/11/2012
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57206
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."

Env Problem: "Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."

Health Problem: "Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
Not reported
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 43:02:00. / 76:09:28.
Dell: False
Record Add: 2003-10-28 13:52:00
Record Upd: 2012-10-04 14:34:00
Updated By: ldennist
Own Op: Document Repository
Sub Type: NNN
Owner Name: Local History & Genealogy Department
Owner Company: Onondaga County Public Library
Owner Address: The Galleries of Syracuse
Owner Addr2: 447 South Salina Street
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Ben Walsh
Owner Company: City of Syracuse
Owner Address: 203 City Hall
Owner Addr2: 233 E Washington Street
Owner City,St,Zip: SYRACUSE (C), NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: C01
Owner Name: Not reported
Owner Company: City of Syracuse
Owner Address: 203 City Hall, 233 E Washington St
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Joshua Cook
Owner Company: NYSDEC Region 7
Owner Address: 615 Erie Blvd West

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13204
Owner Country: United States of America
HW Code: B00024
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NAPHTHALENE

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00
Updated By: JPCOOK
Crossref ID: C300654

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00
Updated By: JPCOOK
Crossref ID: B 5431 P 745
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Control Name: Site Management Plan
HW Code: B00024
Control Code: 32
Control Type: INST
Dt record added: 06/11/2012
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57206
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."

Env Problem: "Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."

Health Problem: "Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."

Not reported
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 43:02:00. / 76:09:28.
Dell: False
Record Add: 2003-10-28 13:52:00
Record Upd: 2012-10-04 14:34:00
Updated By: ldennist
Own Op: Document Repository
Sub Type: NNN
Owner Name: Local History & Genealogy Department
Owner Company: Onondaga County Public Library
Owner Address: The Galleries of Syracuse
Owner Addr2: 447 South Salina Street
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Ben Walsh
Owner Company: City of Syracuse
Owner Address: 203 City Hall
Owner Addr2: 233 E Washington Street
Owner City,St,Zip: SYRACUSE (C), NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: C01
Owner Name: Not reported
Owner Company: City of Syracuse
Owner Address: 203 City Hall, 233 E Washington St
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Joshua Cook
Owner Company: NYSDEC Region 7
Owner Address: 615 Erie Blvd West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13204

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Owner Country: United States of America
HW Code: B00024
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

HW Code: B00024
Waste Type: FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00
Updated By: JPCOOK
Crossref ID: C300654
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00
Updated By: JPCOOK
Crossref ID: B 5431 P 745
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Control Name: IC/EC Plan
HW Code: B00024
Control Code: 34
Control Type: INST
Dt record added: 06/11/2012
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57206
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

	southwest to northeast in this area."
Env Problem:	"Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."
Health Problem:	"Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
	Not reported
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	43:02:00. / 76:09:28.
Dell:	False
Record Add:	2003-10-28 13:52:00
Record Upd:	2012-10-04 14:34:00
Updated By:	ldennist
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Local History & Genealogy Department
Owner Company:	Onondaga County Public Library
Owner Address:	The Galleries of Syracuse
Owner Addr2:	447 South Salina Street
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	C01
Owner Name:	Ben Walsh
Owner Company:	City of Syracuse
Owner Address:	203 City Hall
Owner Addr2:	233 E Washington Street
Owner City,St,Zip:	SYRACUSE (C), NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	C01
Owner Name:	Not reported
Owner Company:	City of Syracuse
Owner Address:	203 City Hall, 233 E Washington St
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Joshua Cook
Owner Company:	NYSDEC Region 7
Owner Address:	615 Erie Blvd West
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13204
Owner Country:	United States of America
HW Code:	B00024

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: FLUORANTHENE

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00
Updated By: JPCOOK
Crossref ID: C300654
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Updated By: JPCOOK
Crossref ID: B 5431 P 745
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Control Name: Monitoring Plan
HW Code: B00024
Control Code: 31
Control Type: INST
Dt record added: 06/11/2012
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57206
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."
Env Problem: "Nature and Extent of Contamination: Prior to remediation, the

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."

Health Problem: "Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
Not reported
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 43:02:00. / 76:09:28.
Dell: False
Record Add: 2003-10-28 13:52:00
Record Upd: 2012-10-04 14:34:00
Updated By: ldennist
Own Op: Document Repository
Sub Type: NNN
Owner Name: Local History & Genealogy Department
Owner Company: Onondaga County Public Library
Owner Address: The Galleries of Syracuse
Owner Addr2: 447 South Salina Street
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Ben Walsh
Owner Company: City of Syracuse
Owner Address: 203 City Hall
Owner Addr2: 233 E Washington Street
Owner City,St,Zip: SYRACUSE (C), NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: C01
Owner Name: Not reported
Owner Company: City of Syracuse
Owner Address: 203 City Hall, 233 E Washington St
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Joshua Cook
Owner Company: NYSDEC Region 7
Owner Address: 615 Erie Blvd West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13204
Owner Country: United States of America
HW Code: B00024
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Waste Code: Not reported
HW Code: B00024
Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

HW Code: B00024
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00
Updated By: JPCOOK
Crossref ID: C300654
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00
Updated By: JPCOOK
Crossref ID: B 5431 P 745

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Control Name: Environmental Easement
HW Code: B00024
Control Code: J
Control Type: INST
Dt record added: 06/11/2012
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57206
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."
Env Problem: "Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."

Health Problem: "Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
Not reported
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 43:02:00. / 76:09:28.
Dell: False
Record Add: 2003-10-28 13:52:00
Record Upd: 2012-10-04 14:34:00
Updated By: ldennist
Own Op: Document Repository
Sub Type: NNN
Owner Name: Local History & Genealogy Department
Owner Company: Onondaga County Public Library
Owner Address: The Galleries of Syracuse
Owner Addr2: 447 South Salina Street
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Ben Walsh
Owner Company: City of Syracuse
Owner Address: 203 City Hall
Owner Addr2: 233 E Washington Street
Owner City,St,Zip: SYRACUSE (C), NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: C01
Owner Name: Not reported
Owner Company: City of Syracuse
Owner Address: 203 City Hall, 233 E Washington St
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Joshua Cook
Owner Company: NYSDEC Region 7
Owner Address: 615 Erie Blvd West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13204
Owner Country: United States of America
HW Code: B00024
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO[K]FLUORANTHENE

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00
Updated By: JPCOOK
Crossref ID: C300654
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00
Updated By: JPCOOK
Crossref ID: B 5431 P 745
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

ERP:
Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Program: ERP
HW Code: B00024
Site Class: C
Class N: C
SWIS: 3415
Region: 7
Town: Syracuse (c)
Acres: 0.800
Record Added: 10/28/2003
Record Updated: 02/05/2024
Updated By: GWPRISCO
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."
Env Problem: "Nature and Extent of Contamination: Prior to remediation, the

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."

Health Problem: "Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
Not reported

NY MANIFEST:

EPA ID:	NYR000223016
Country:	USA
Name:	BROWN MANUFACTURING SITE FORMER
Address:	101 CHESTER ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13207
Zip 4:	Not reported
Location Address 1:	101 CHESTER STREET
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13207
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	BROWN MANUFACTURING SITE FORMER
Mailing Contact:	JOSHUA COOK
Mailing Address 1:	201 E WASHINGTON ST
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154267411

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD084814136
Year:	2018
Trans2 State ID:	MIK435642742
Generator Ship Date:	11/01/2016
Trans1 Recv Date:	11/01/2016
Trans2 Recv Date:	11/02/2016
TSD Site Recv Date:	11/18/2016
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000223016
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	MID048090633
TSDF ID 2:	Not reported
Manifest Tracking Number:	015187140JJK
Import Indicator:	N
Export Indicator:	N

FORMER BROWN MANUFACTURING SITE (Continued) **S105859104**

Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Not reported
Waste Code b:	B007
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	2727
Units:	Kilograms
Number of Containers:	3
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

168
NNW
1/2-1
0.771 mi.
4070 ft.

NIMO - SYRACUSE - ERIE MGP **EDR MGP** **1008408047**
300 ERIC BLVD WEST **N/A**
SYRACUSE, NY 13202

Relative:
Higher

Actual:
400 ft.

EDR MGP:

No additional information available

169
NW
1/2-1
0.806 mi.
4258 ft.

NM - SYRACUSE ERIE BLVD. MGP **NY SHWS** **S111065346**
300 ERIE BLVD WEST **NY LTANKS** **N/A**
SYRACUSE, NY 13208 **NY ENG CONTROLS**
NY INST CONTROL
NY Spills
NY MGP

Relative:
Higher

Actual:
400 ft.

SHWS:

Name:	NM - SYRACUSE ERIE BLVD. MGP
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13208-
Program:	HW
Site Code:	56354
Classification:	C
Region:	7
Acres:	8.190

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

HW Code: 734060
Record Add: 11/18/1999
Record Upd: 07/27/2023
Updated By: AMOMOROG
Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem: "Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 00:00:00:0 / 00:00:00:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 2015-01-05 15:51:00
Updated By: ALKARWIE
Own Op: Document Repository
Sub Type: C04
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Owner Name:	Steve Beam
Owner Company:	National Grid
Owner Address:	300 Erie Blvd. West
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	734060
Waste Type:	COAL TAR
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	NAPHTHALENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	2020-00007787
Cross Ref Type Code:	31
Cross Ref Type:	Environmental Easement No.
Record Added Date:	2020-04-20 15:36:00
Record Updated:	2020-04-20 15:36:00
Updated By:	JEBROWN
Crossref ID:	2020-00007787
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2020-04-20 15:36:00
Record Updated:	2020-07-15 14:36:00
Updated By:	SMQUANDT
Crossref ID:	A4-0473-0000
Cross Ref Type Code:	26
Cross Ref Type:	Agreement/Consent Order Date
Record Added Date:	2018-01-12 09:16:00
Record Updated:	2018-01-12 09:18:00
Updated By:	JTSPELLM

LTANKS:

Name:	NIMOSYR
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8710546 / 1988-05-20
Facility ID:	8710546
Site ID:	150027
Spill Date:	1988-03-17
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Cleanup Ceased:	1988-05-20
SWIS:	3415
Investigator:	AJMARSCH
Referred To:	Not reported
Reported to Dept:	1988-03-17
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1988-03-31
Spill Record Last Update:	1988-06-02
Spiller Name:	Not reported
Spiller Company:	NIAGARA MOHAWK
Spiller Address:	Not reported
Spiller County:	999
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	327390
Latitude:	43.0509891
Longitude:	-76.1555806
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was JM 04/07/88: TANK WAS RETESED ON 4/7/88 AFTER PIPING MODIFICATIONS WERE COMPLETED. TANK FAILED RETEST. NIMO HAD 2000 GAL TANK PUMPED OUT AND PUT REMOVAL UP FOR BID.ANTICIPATE 30 DAY LAG FOR REMOVAL. (CHRIS WHITE). 05/20/88: LINE WAS REPAIRED . TANK IS TIGHT. 09/28/95: This is additional information about material spilled from the translation of the old spill file: UNK QUANTITY.
Remarks:	2000 GAL TANK SYATEM FAILED PETROTITE 2.0 GPH____ CLEMENT.

All Materials:

Site ID:	150027
Operable Unit ID:	915453
Operable Unit:	01
Material ID:	462317
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

ENG CONTROLS:

Name:	NM - SYRACUSE ERIE BLVD. MGP
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13208-
Site Code:	56354
HW Code:	734060
Control Code:	36
Control Type:	ENG
Date Record Added:	12/20/2021
Date Rec Updated:	04/01/2024
Updated By:	JTSPELLM
Site Description:	"Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

	west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem:	"Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem:	"Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	00:00:00:0 / 00:00:00:0
Dell:	False
Record Add:	1999-11-18 12:00:00
Record Upd:	2015-01-05 15:51:00
Updated By:	ALKARWIE
Own Op:	Document Repository
Sub Type:	C04
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	03
Owner Name:	Steve Beam
Owner Company:	National Grid
Owner Address:	300 Erie Blvd. West
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	734060
Waste Type:	COAL TAR

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	NAPHTHALENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	2020-00007787
Cross Ref Type Code:	31
Cross Ref Type:	Environmental Easement No.
Record Added Date:	2020-04-20 15:36:00
Record Updated:	2020-04-20 15:36:00
Updated By:	JEBROWN
Crossref ID:	2020-00007787
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2020-04-20 15:36:00
Record Updated:	2020-07-15 14:36:00
Updated By:	SMQUANDT
Crossref ID:	A4-0473-0000
Cross Ref Type Code:	26
Cross Ref Type:	Agreement/Consent Order Date
Record Added Date:	2018-01-12 09:16:00
Record Updated:	2018-01-12 09:18:00
Updated By:	JTSPELLM

Name:	NM - SYRACUSE ERIE BLVD. MGP
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13208-
Site Code:	56354
HW Code:	734060
Control Code:	15
Control Type:	ENG
Date Record Added:	03/08/2024
Date Rec Updated:	04/01/2024
Updated By:	JTSPELLM
Site Description:	"Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

	surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem:	"Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem:	"Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	00:00:00:0 / 00:00:00:0
Dell:	False
Record Add:	1999-11-18 12:00:00
Record Upd:	2015-01-05 15:51:00
Updated By:	ALKARWIE
Own Op:	Document Repository
Sub Type:	C04
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	03
Owner Name:	Steve Beam
Owner Company:	National Grid
Owner Address:	300 Erie Blvd. West
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	734060
Waste Type:	COAL TAR
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	NAPHTHALENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	2020-00007787
Cross Ref Type Code:	31
Cross Ref Type:	Environmental Easement No.
Record Added Date:	2020-04-20 15:36:00

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

INST CONTROL:
Name: NM - SYRACUSE ERIE BLVD. MGP
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY 13208-
Site Code: 56354
Control Name: Site Management Plan
HW Code: 734060
Control Code: 32
Control Type: INST
Dt record added: 03/08/2024
Dt rec updated: 04/01/2024
Updated By: JTSPELLM
Site Code: 56354
Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Health Problem: "Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 00:00:00:0 / 00:00:00:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 2015-01-05 15:51:00
Updated By: ALKARWIE
Own Op: Document Repository
Sub Type: C04
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03
Owner Name: Steve Beam
Owner Company: National Grid
Owner Address: 300 Erie Blvd. West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: 734060
Waste Type: COAL TAR
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

Name: NM - SYRACUSE ERIE BLVD. MGP
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY 13208-
Site Code: 56354
Control Name: IC/EC Plan
HW Code: 734060
Control Code: 34
Control Type: INST
Dt record added: 03/08/2024
Dt rec updated: 04/01/2024
Updated By: JTSPELLM
Site Code: 56354
Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem: "Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 00:00:00:0 / 00:00:00:0
Dell: False
Record Add: 1999-11-18 12:00:00

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Record Upd: 2015-01-05 15:51:00
Updated By: ALKARWIE
Own Op: Document Repository
Sub Type: C04
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03
Owner Name: Steve Beam
Owner Company: National Grid
Owner Address: 300 Erie Blvd. West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: 734060
Waste Type: COAL TAR
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

Name: NM - SYRACUSE ERIE BLVD. MGP
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY 13208-
Site Code: 56354
Control Name: Soil Management Plan
HW Code: 734060
Control Code: 14
Control Type: INST

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Dt record added: 03/08/2024
Dt rec updated: 04/01/2024
Updated By: JTSPELLM
Site Code: 56354
Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem: "Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 00:00:00:0 / 00:00:00:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 2015-01-05 15:51:00
Updated By: ALKARWIE
Own Op: Document Repository
Sub Type: C04
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Owner Name: Steve Beam
Owner Company: National Grid
Owner Address: 300 Erie Blvd. West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: 734060
Waste Type: COAL TAR
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

Name: NM - SYRACUSE ERIE BLVD. MGP
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY 13208-
Site Code: 56354
Control Name: Landuse Restriction
HW Code: 734060
Control Code: 25
Control Type: INST
Dt record added: 03/08/2024
Dt rec updated: 04/01/2024
Updated By: JTSPELLM
Site Code: 56354
Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."

Health Problem: "Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 00:00:00:0 / 00:00:00:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 2015-01-05 15:51:00
Updated By: ALKARWIE
Own Op: Document Repository
Sub Type: C04
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03
Owner Name: Steve Beam
Owner Company: National Grid
Owner Address: 300 Erie Blvd. West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: 734060
Waste Type: COAL TAR
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: NAPHTHALENE

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

Name: NM - SYRACUSE ERIE BLVD. MGP
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY 13208-
Site Code: 56354
Control Name: Monitoring Plan
HW Code: 734060
Control Code: 31
Control Type: INST
Dt record added: 03/08/2024
Dt rec updated: 04/01/2024
Updated By: JTSPELLM
Site Code: 56354
Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north.

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

	The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem:	"Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem:	"Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	00:00:00:0 / 00:00:00:0
Dell:	False
Record Add:	1999-11-18 12:00:00
Record Upd:	2015-01-05 15:51:00
Updated By:	ALKARWIE
Own Op:	Document Repository
Sub Type:	C04
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	03
Owner Name:	Steve Beam
Owner Company:	National Grid
Owner Address:	300 Erie Blvd. West
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	734060
Waste Type:	COAL TAR
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	NAPHTHALENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	2020-00007787
Cross Ref Type Code:	31
Cross Ref Type:	Environmental Easement No.
Record Added Date:	2020-04-20 15:36:00
Record Updated:	2020-04-20 15:36:00
Updated By:	JEBROWN

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

Name: NM - SYRACUSE ERIE BLVD. MGP
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY 13208-
Site Code: 56354
Control Name: Environmental Easement
HW Code: 734060
Control Code: J
Control Type: INST
Dt record added: 03/08/2024
Dt rec updated: 04/01/2024
Updated By: JTSPELLM
Site Code: 56354
Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem: "Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump: False

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 00:00:00:0 / 00:00:00:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 2015-01-05 15:51:00
Updated By: ALKARWIE
Own Op: Document Repository
Sub Type: C04
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03
Owner Name: Steve Beam
Owner Company: National Grid
Owner Address: 300 Erie Blvd. West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: 734060
Waste Type: COAL TAR
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Name:	NM - SYRACUSE ERIE BLVD. MGP
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13208-
Site Code:	56354
Control Name:	Ground Water Use Restriction
HW Code:	734060
Control Code:	08
Control Type:	INST
Dt record added:	03/08/2024
Dt rec updated:	04/01/2024
Updated By:	JTSPELLM
Site Code:	56354
Site Description:	"Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem:	"Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem:	"Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	00:00:00:0 / 00:00:00:0
Dell:	False
Record Add:	1999-11-18 12:00:00
Record Upd:	2015-01-05 15:51:00
Updated By:	ALKARWIE
Own Op:	Document Repository
Sub Type:	C04

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03
Owner Name: Steve Beam
Owner Company: National Grid
Owner Address: 300 Erie Blvd. West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: 734060
Waste Type: COAL TAR
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

SPILLS:
Name: SYRACUSE OFFICE
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 0612888 / 2007-07-03
Facility ID: 0612888
Facility Type: ER
DER Facility ID: 327390
Site ID: 377833
DEC Region: 7
Spill Cause: Equipment Failure
Spill Class: D4

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

SWIS:	3415
Spill Date:	2007-03-01
Investigator:	hdwarner
Referred To:	Not reported
Reported to Dept:	2007-03-01
CID:	444
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2007-03-01
Spill Record Last Update:	2007-07-03
Spiller Name:	BOB CAZZOLLI
Spiller Company:	SYRACUSE OFFICE
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	001
Contact Name:	BOB CAZZOLLI
Latitude:	43.0515713
Longitude:	-76.1571976
DEC Memo:	Not reported
Remarks:	LEAKER ON A CHILLER SYSTEM : CONTAINED ON FLORR AND ISOLATED DRAIN: CREW ONM SITE

All Materials:

Site ID:	377833
Operable Unit ID:	1135351
Operable Unit:	01
Material ID:	2125250
Material Code:	0013
Material Name:	lube oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	DOWNTOWN OFFICE HQ
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0904025 / 2009-07-07
Facility ID:	0904025
Facility Type:	ER
DER Facility ID:	327390
Site ID:	416166
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	E4
SWIS:	3415
Spill Date:	2009-07-07
Investigator:	kacahill

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Referred To:	Not reported
Reported to Dept:	2009-07-07
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-07-07
Spill Record Last Update:	2009-07-07
Spiller Name:	Not reported
Spiller Company:	NAT GRID
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	CALLER
Latitude:	43.0515713
Longitude:	-76.1571976
DEC Memo:	Referred to Div. of Air
Remarks:	Released to atmosphere. Notification required.

All Materials:

Site ID:	416166
Operable Unit ID:	1172480
Operable Unit:	01
Material ID:	2164352
Material Code:	0050A
Material Name:	freon
Case No.:	Not reported
Material FA:	Other
Quantity:	9.00
Units:	L
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	NAT GRID
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13204
Spill Number/Closed Date:	1110921 / 2011-12-09
Facility ID:	1110921
Facility Type:	ER
DER Facility ID:	346519
Site ID:	458784
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2011-12-08
Investigator:	MJROMOCK
Referred To:	Not reported
Reported to Dept:	2011-12-08
CID:	Not reported
Water Affected:	Not reported

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2011-12-08
Spill Record Last Update:	2011-12-09
Spiller Name:	SUE SWANSON
Spiller Company:	NAT GRID
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	999
Contact Name:	SUE SWANSON
Latitude:	43.0515713
Longitude:	-76.1571976
DEC Memo:	referred to NYSDEC Division of Air Quality.
Remarks:	equip out of service

All Materials:

Site ID:	458784
Operable Unit ID:	1208899
Operable Unit:	01
Material ID:	2206253
Material Code:	1581A
Material Name:	refrigerant
Case No.:	Not reported
Material FA:	Other
Quantity:	175.00
Units:	L
Recovered:	Not reported
Resource Affected:	Air
Oxygenate:	Not reported

Name:	NATIONAL GRID
Address:	300 ERIE BLVD. WEST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1403483 / 2014-07-02
Facility ID:	1403483
Facility Type:	ER
DER Facility ID:	451864
Site ID:	496844
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2014-07-01
Investigator:	SMFITZGE
Referred To:	Not reported
Reported to Dept:	2014-07-01
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2014-07-01
Spill Record Last Update:	2014-07-02
Spiller Name:	CARIG SMITH
Spiller Company:	YARD SMITH
Spiller Address:	300 ERIE BLVD. WEST
Spiller Company:	999
Contact Name:	CARIG SMITH
Latitude:	43.0515713
Longitude:	-76.1571976
DEC Memo:	Cleaned with speedy dry and swept up.
Remarks:	broken tansmission line on a truck owner by yard smith. fluid spilled to black top. clean up is done.

All Materials:

Site ID:	496844
Operable Unit ID:	1246321
Operable Unit:	01
Material ID:	2247472
Material Code:	0021
Material Name:	transmission fluid
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.25
Units:	G
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	NATIONAL GRID
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13204
Spill Number/Closed Date:	0801186 / 2008-04-30
Facility ID:	0801186
Facility Type:	ER
DER Facility ID:	346519
Site ID:	397071
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2007-07-30
Investigator:	KCKEMP
Referred To:	DAR
Reported to Dept:	2008-04-29
CID:	404
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	2008-04-30
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Remediation Phase:	0
Date Entered In Computer:	2008-04-29
Spill Record Last Update:	2008-04-30
Spiller Name:	SUE SWANSON
Spiller Company:	NATIONAL GRID
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	001
Contact Name:	SUE SWANSON
Latitude:	43.0515713
Longitude:	-76.1571976
DEC Memo:	Not reported
Remarks:	r22; equipment failure; spoke to Kevin Kemp of Reg 7

All Materials:

Site ID:	397071
Operable Unit ID:	1154031
Operable Unit:	01
Material ID:	2144817
Material Code:	1581A
Material Name:	refrigerant
Case No.:	Not reported
Material FA:	Other
Quantity:	2.00
Units:	L
Recovered:	.00
Resource Affected:	Air
Oxygenate:	Not reported

Name:	NATIONAL GRID
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13204
Spill Number/Closed Date:	0801187 / 2008-04-30
Facility ID:	0801187
Facility Type:	ER
DER Facility ID:	346519
Site ID:	397072
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2007-11-12
Investigator:	KCKEMP
Referred To:	DAR
Reported to Dept:	2008-04-29
CID:	404
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	2008-04-30
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2008-04-29
Spill Record Last Update:	2008-04-30
Spiller Name:	SUE SWANSON

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Spiller Company:	NATIONALGRID
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	001
Contact Name:	SUE SWANSON
Latitude:	43.0515713
Longitude:	-76.1571976
DEC Memo:	Not reported
Remarks:	28 ounces released of r22; spoke to Kevin Kemp region 7; equipment failure

All Materials:

Site ID:	397072
Operable Unit ID:	1154032
Operable Unit:	01
Material ID:	2144818
Material Code:	1581A
Material Name:	refrigerant
Case No.:	Not reported
Material FA:	Other
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Air
Oxygenate:	Not reported

Name:	STREETSIDE
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1103514 / 2011-06-29
Facility ID:	1103514
Facility Type:	ER
DER Facility ID:	327390
Site ID:	451079
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2011-06-28
Investigator:	DJLASALL
Referred To:	Not reported
Reported to Dept:	2011-06-28
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2011-06-28
Spill Record Last Update:	2011-06-29
Spiller Name:	NATIONAL GRID
Spiller Company:	NATIONAL GRID
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	999

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Contact Name:	NATIONAL GRID
Latitude:	43.0515713
Longitude:	-76.1571976
DEC Memo:	Not reported
Remarks:	Leaked from NG vehicel onto blacktop parking lot. Cleanup by Op-tech already.

All Materials:

Site ID:	451079
Operable Unit ID:	1201280
Operable Unit:	01
Material ID:	2197797
Material Code:	0015
Material Name:	motor oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	NATIONAL GRID MAIN OFFICE
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1011328 / 2011-02-11
Facility ID:	1011328
Facility Type:	ER
DER Facility ID:	45158
Site ID:	445184
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	E5
SWIS:	3415
Spill Date:	2011-02-11
Investigator:	menash
Referred To:	Not reported
Reported to Dept:	2011-02-11
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2011-02-11
Spill Record Last Update:	2011-02-11
Spiller Name:	Not reported
Spiller Company:	NATIONAL GRID
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	BOB CAZZOLLI
Latitude:	43.0515713
Longitude:	-76.1571976

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

DEC Memo: Turned over to Air Quality 2/11/11
Remarks: repair done - in B Bldg -

All Materials:
Site ID: 445184
Operable Unit ID: 1195409
Operable Unit: 01
Material ID: 2191547
Material Code: 1581A
Material Name: refrigerant
Case No.: Not reported
Material FA: Other
Quantity: 58.00
Units: L
Recovered: Not reported
Resource Affected: Air
Oxygenate: Not reported

Name: AC UNIT - NATIONAL GRID BLDG
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 1105869 / 2011-08-24
Facility ID: 1105869
Facility Type: ER
DER Facility ID: 327390
Site ID: 453537
DEC Region: 7
Spill Cause: Equipment Failure
Spill Class: E5
SWIS: 3415
Spill Date: 2011-08-23
Investigator: DJLASALL
Referred To: Not reported
Reported to Dept: 2011-08-23
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Not reported
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2011-08-23
Spill Record Last Update: 2011-08-24
Spiller Name: SUE SWANSON
Spiller Company: NATIONAL GRID
Spiller Address: 300 ERIE BLVD WEST
Spiller Company: 999
Contact Name: SUE SWANSON
Latitude: 43.0515713
Longitude: -76.1571976
DEC Memo: Not reported
Remarks: R-22. Unit repaired and recharged.

All Materials:

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Site ID:	453537
Operable Unit ID:	1203693
Operable Unit:	01
Material ID:	2200369
Material Code:	1581A
Material Name:	refrigerant
Case No.:	Not reported
Material FA:	Other
Quantity:	9.90
Units:	L
Recovered:	Not reported
Resource Affected:	Air
Oxygenate:	Not reported

Name:	NAT GRID OFFICE / D BLD
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1012998 / 2011-03-30
Facility ID:	1012998
Facility Type:	ER
DER Facility ID:	327390
Site ID:	447299
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	E5
SWIS:	3415
Spill Date:	2011-03-30
Investigator:	MJROMOCK
Referred To:	Not reported
Reported to Dept:	2011-03-30
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2011-03-30
Spill Record Last Update:	2011-03-30
Spiller Name:	BOB CAZZOLI
Spiller Company:	NAT GRID OFFICE / D BLD
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	999
Contact Name:	BOB CAZZOLI
Latitude:	43.0515713
Longitude:	-76.1571976
DEC Memo:	3/30/11 Referred to NYSDEC Division of Air Resources.
Remarks:	leak on fitting, repair pending

All Materials:

Site ID:	447299
Operable Unit ID:	1197442
Operable Unit:	01
Material ID:	2193758

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Material Code:	1581A
Material Name:	refrigerant
Case No.:	Not reported
Material FA:	Other
Quantity:	2.00
Units:	G
Recovered:	.00
Resource Affected:	Air
Oxygenate:	Not reported

Name:	NATIONAL GRID SYRACUSE OFFICE
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1000219 / 2010-04-06
Facility ID:	1000219
Facility Type:	ER
DER Facility ID:	327390
Site ID:	431380
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	E5
SWIS:	3415
Spill Date:	2010-04-05
Investigator:	DJLASALL
Referred To:	Not reported
Reported to Dept:	2010-04-06
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2010-04-06
Spill Record Last Update:	2010-04-08
Spiller Name:	BOB CAZZOLLI
Spiller Company:	NATIONAL GRID SYRACUSE OFFICE
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	999
Contact Name:	BOB CAZZOLLI
Latitude:	43.0515713
Longitude:	-76.1571976
DEC Memo:	Emailed spill report to Reggie Parker, Regional Air Engineer 4/6/10
Remarks:	valve leak; Cylinder emptied into another

All Materials:

Site ID:	431380
Operable Unit ID:	1182832
Operable Unit:	01
Material ID:	2177036
Material Code:	0050A
Material Name:	freon
Case No.:	Not reported
Material FA:	Other

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Quantity:	14.00
Units:	L
Recovered:	Not reported
Resource Affected:	Air
Oxygenate:	Not reported

Click this hyperlink while viewing on your computer to access
7 additional NY SPILL: record(s) in the EDR Site Report.

MGP:

Site ID:	734060
Name:	NM - SYRACUSE ERIE BLVD. MGP
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13208-
Region:	7
Class:	Completed: The classification used for sites where the Department has determined that remediation has been satisfactorily completed under a remedial program (i. e., State Superfund, Brownfield Cleanup Program, Environmental Restoration Program, Voluntary Cleanup Program, and RCRA Corrective Action Program). State Superfund (Registry) sites must have completed all active operation, maintenance, or monitoring requirements before they can be delisted and made class C. Non-registry sites may be made a class C after successful completion of all required construction or after a no further action remedy has been selected by the Department. These sites will be issued a Certificate of Completion (COC), but may still require ongoing maintenance and periodic certification of institutional/engineering controls (IC/ECs).
Swis Code:	3415
Town:	Syracuse (c)
Disp Start:	Not reported
Disp Term:	Not reported
Acres:	8.19
Fuse:	Commercial
Description:	Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes.

Assess Env: Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan.

Assess Doh: Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination.

Latitude: 43.05179455

Longitude: -76.15718559

Count: 7 records. ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
SYRACUSE	S104619126	SPILL NUMBER 8601051	CEDAR ST		NY LTANKS
SYRACUSE	S108146406	ROTONDO WAREHOUSE	WEST DIVISION STREET	13204	NY SHWS, NY HSWDS
SYRACUSE	1015735659	NIAGARA MOHAWK /NM HQ	ERIE BOULEVARD WEST	13202	SEMS-ARCHIVE
SYRACUSE	S113916541	W.JEFFERSON ST. ROADWAY&ROW(400 OF	WEST JEFFERSON STREET	13202	NY VCP, NY BROWNFIELDS
SYRACUSE	S113916519	FORM. DUPLI GRAPHICS FACILITY(400	358 WEST JEFFERSON STREET & WE	13202	NY VCP, NY BROWNFIELDS
SYRACUSE	S113492639	SIDA PROPERTIES	SOUTH SALINA/MONTGOMERY STREET	13202	NY SHWS
SYRACUSE	S106905168	OLD TIP-TOP BAKERY	SHONNARD STREET	13204	NY SHWS

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal NPL (Superfund) sites

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 05/22/2024
Date Data Arrived at EDR: 06/03/2024
Date Made Active in Reports: 06/26/2024
Number of Days to Update: 23

Source: EPA
Telephone: N/A
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 10/07/2024
Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 3
Telephone 215-814-5418

EPA Region 4
Telephone 404-562-8033

EPA Region 5
Telephone 312-886-6686

EPA Region 10
Telephone 206-553-8665

EPA Region 6
Telephone: 214-655-6659

EPA Region 7
Telephone: 913-551-7247

EPA Region 8
Telephone: 303-312-6774

EPA Region 9
Telephone: 415-947-4246

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 05/22/2024
Date Data Arrived at EDR: 06/03/2024
Date Made Active in Reports: 06/26/2024
Number of Days to Update: 23

Source: EPA
Telephone: N/A
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 10/07/2024
Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

Lists of Federal Delisted NPL sites

Delisted NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 05/22/2024
Date Data Arrived at EDR: 06/03/2024
Date Made Active in Reports: 06/26/2024
Number of Days to Update: 23

Source: EPA
Telephone: N/A
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 10/07/2024
Data Release Frequency: Quarterly

Lists of Federal sites subject to CERCLA removals and CERCLA orders

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 03/25/2024
Date Data Arrived at EDR: 03/26/2024
Date Made Active in Reports: 06/24/2024
Number of Days to Update: 90

Source: Environmental Protection Agency
Telephone: 703-603-8704
Last EDR Contact: 06/25/2024
Next Scheduled EDR Contact: 10/07/2024
Data Release Frequency: Varies

SEMS: Superfund Enterprise Management System

SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly know as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 04/22/2024
Date Data Arrived at EDR: 05/01/2024
Date Made Active in Reports: 05/24/2024
Number of Days to Update: 23

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 10/21/2024
Data Release Frequency: Quarterly

Lists of Federal CERCLA sites with NFRAP

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that. based upon available information, the location is not judged to be potential NPL site.

Date of Government Version: 04/22/2024
Date Data Arrived at EDR: 05/01/2024
Date Made Active in Reports: 05/24/2024
Number of Days to Update: 23

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 10/21/2024
Data Release Frequency: Quarterly

Lists of Federal RCRA facilities undergoing Corrective Action

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 06/03/2024
Date Data Arrived at EDR: 06/07/2024
Date Made Active in Reports: 06/20/2024
Number of Days to Update: 13

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 06/07/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Quarterly

Lists of Federal RCRA TSD facilities

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 06/03/2024
Date Data Arrived at EDR: 06/07/2024
Date Made Active in Reports: 06/20/2024
Number of Days to Update: 13

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 06/07/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Quarterly

Lists of Federal RCRA generators

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 06/03/2024
Date Data Arrived at EDR: 06/07/2024
Date Made Active in Reports: 06/20/2024
Number of Days to Update: 13

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 06/07/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 06/03/2024
Date Data Arrived at EDR: 06/07/2024
Date Made Active in Reports: 06/20/2024
Number of Days to Update: 13

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 06/07/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Quarterly

RCRA-VSQG: RCRA - Very Small Quantity Generators (Formerly Conditionally Exempt Small Quantity Generators)

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Very small quantity generators (VSQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 06/03/2024
Date Data Arrived at EDR: 06/07/2024
Date Made Active in Reports: 06/20/2024
Number of Days to Update: 13

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 06/07/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Quarterly

Federal institutional controls / engineering controls registries

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 02/14/2024
Date Data Arrived at EDR: 02/16/2024
Date Made Active in Reports: 04/04/2024
Number of Days to Update: 48

Source: Department of the Navy
Telephone: 843-820-7326
Last EDR Contact: 07/31/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Varies

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 07/24/2024
Date Data Arrived at EDR: 08/08/2024
Date Made Active in Reports: 08/15/2024
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 08/08/2024
Next Scheduled EDR Contact: 12/02/2024
Data Release Frequency: Varies

US INST CONTROLS: Institutional Controls Sites List

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 07/24/2024
Date Data Arrived at EDR: 08/08/2024
Date Made Active in Reports: 08/15/2024
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 08/08/2024
Next Scheduled EDR Contact: 12/02/2024
Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 03/13/2024
Date Data Arrived at EDR: 03/19/2024
Date Made Active in Reports: 06/17/2024
Number of Days to Update: 90

Source: National Response Center, United States Coast Guard
Telephone: 202-267-2180
Last EDR Contact: 06/17/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Quarterly

Lists of state- and tribal hazardous waste facilities

SHWS: Inactive Hazardous Waste Disposal Sites in New York State

Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites

Date of Government Version: 08/01/2024
Date Data Arrived at EDR: 08/01/2024
Date Made Active in Reports: 08/05/2024
Number of Days to Update: 4

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Annually

Lists of state and tribal landfills and solid waste disposal facilities

SWF/LF: Facility Register

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 03/25/2024
Date Data Arrived at EDR: 03/27/2024
Date Made Active in Reports: 06/18/2024
Number of Days to Update: 83

Source: Department of Environmental Conservation
Telephone: 518-402-8678
Last EDR Contact: 06/21/2024
Next Scheduled EDR Contact: 10/07/2024
Data Release Frequency: Quarterly

Lists of state and tribal leaking storage tanks

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 10/25/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 10/25/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: Environmental Protection Agency
Telephone: 415-972-3372
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land

Leaking underground storage tanks located on Indian Land in Michigan, Minnesota and Wisconsin.

Date of Government Version: 10/04/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA, Region 5
Telephone: 312-886-7439
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 10/25/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA Region 8
Telephone: 303-312-6271
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 10/25/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA Region 4
Telephone: 404-562-8677
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 10/25/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA Region 6
Telephone: 214-665-6597
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 10/25/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 10/25/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

LTANKS: Spills Information Database
Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills.

Date of Government Version: 07/30/2024
Date Data Arrived at EDR: 07/31/2024
Date Made Active in Reports: 08/05/2024
Number of Days to Update: 5

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/31/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Varies

HIST LTANKS: Listing of Leaking Storage Tanks

A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 07/08/2005
Date Made Active in Reports: 07/14/2005
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/07/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

Lists of state and tribal registered storage tanks

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 03/15/2024
Date Data Arrived at EDR: 03/19/2024
Date Made Active in Reports: 06/17/2024
Number of Days to Update: 90

Source: FEMA
Telephone: 202-646-5797
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

UST: Petroleum Bulk Storage (PBS) Database

Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 03/19/2024
Date Data Arrived at EDR: 03/20/2024
Date Made Active in Reports: 06/12/2024
Number of Days to Update: 84

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 06/18/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: No Update Planned

CBS UST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in underground tanks of any size

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 10/24/2005
Next Scheduled EDR Contact: 01/23/2006
Data Release Frequency: No Update Planned

MOSF UST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

MOSF: Major Oil Storage Facility Site Listing

These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 03/19/2024
Date Data Arrived at EDR: 03/20/2024
Date Made Active in Reports: 06/12/2024
Number of Days to Update: 84

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 06/18/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CBS: Chemical Bulk Storage Site Listing

These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

Date of Government Version: 03/19/2024
Date Data Arrived at EDR: 03/20/2024
Date Made Active in Reports: 06/12/2024
Number of Days to Update: 84

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 06/18/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Quarterly

AST: Petroleum Bulk Storage

Registered Aboveground Storage Tanks.

Date of Government Version: 03/19/2024
Date Data Arrived at EDR: 03/20/2024
Date Made Active in Reports: 06/12/2024
Number of Days to Update: 84

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 06/18/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: No Update Planned

CBS AST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

MOSF AST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 10/24/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA Region 9
Telephone: 415-972-3368
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 10/24/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 10/24/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA Region 8
Telephone: 303-312-6137
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 10/24/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 10/24/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 10/24/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 10/17/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA Region 5
Telephone: 312-886-6136
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 10/24/2023
Date Data Arrived at EDR: 01/17/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 56

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

TANKS: Storage Tank Faciliy Listing

This database contains records of facilities that are or have been regulated under Bulk Storage Program. Tank information for these facilities may not be releasable by the state agency.

Date of Government Version: 03/19/2024
Date Data Arrived at EDR: 03/20/2024
Date Made Active in Reports: 06/12/2024
Number of Days to Update: 84

Source: Department of Environmental Conservation
Telephone: 518-402-9543
Last EDR Contact: 06/18/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Quarterly

State and tribal institutional control / engineering control registries

ENV RES DECL: Environmental Restrictive Declarations

The Environmental Restrictive Declarations (ERD) listed were recorded in connection with a zoning action against the noted Tax Blocks and Tax Lots, or portion thereof, and are available in the property records on file at the Office of the City Register for Bronx, Kings, New York and Queens counties or at the Richmond County Clerk's office. They contain environmental requirements with respect to hazardous materials, air quality and/or noise in accordance with Section 11-15 of this Resolution.

Date of Government Version: 03/11/2024
Date Data Arrived at EDR: 03/14/2024
Date Made Active in Reports: 06/05/2024
Number of Days to Update: 83

Source: New York City Department of City Planning
Telephone: 212-720-3300
Last EDR Contact: 06/13/2024
Next Scheduled EDR Contact: 09/23/2024
Data Release Frequency: Varies

RES DECL: Restrictive Declarations Listing

A restrictive declaration is a covenant running with the land which binds the present and future owners of the property. As a condition of certain special permits, the City Planning Commission may require an applicant to sign and record a restrictive declaration that places specified conditions on the future use and development of the property. Certain restrictive declarations are indicated by a D on zoning maps.

Date of Government Version: 03/04/2024
Date Data Arrived at EDR: 03/07/2024
Date Made Active in Reports: 03/11/2024
Number of Days to Update: 4

Source: NYC Department of City Planning
Telephone: 212-720-3401
Last EDR Contact: 06/13/2024
Next Scheduled EDR Contact: 09/23/2024
Data Release Frequency: Varies

ENG CONTROLS: Registry of Engineering Controls

Environmental Remediation sites that have engineering controls in place.

Date of Government Version: 08/01/2024
Date Data Arrived at EDR: 08/01/2024
Date Made Active in Reports: 08/05/2024
Number of Days to Update: 4

Source: Department of Environmental Conservation
Telephone: 518-402-9553
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Quarterly

INST CONTROL: Registry of Institutional Controls

Environmental Remediation sites that have institutional controls in place.

Date of Government Version: 08/01/2024
Date Data Arrived at EDR: 08/01/2024
Date Made Active in Reports: 08/05/2024
Number of Days to Update: 4

Source: Department of Environmental Conservation
Telephone: 518-402-9553
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Quarterly

Lists of state and tribal voluntary cleanup sites

VCP: Voluntary Cleanup Agreements

New York established its Voluntary Cleanup Program (VCP) to address the environmental, legal and financial barriers that often hinder the redevelopment and reuse of contaminated properties. The Voluntary Cleanup Program was developed to enhance private sector cleanup of brownfields by enabling parties to remediate sites using private rather than public funds and to reduce the development pressures on "greenfield" sites.

Date of Government Version: 08/01/2024
Date Data Arrived at EDR: 08/01/2024
Date Made Active in Reports: 08/05/2024
Number of Days to Update: 4

Source: Department of Environmental Conservation
Telephone: 518-402-9711
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Semi-Annually

INDIAN VCP R7: Voluntary Cleanup Priority Lisitng
A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27

Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 07/08/2021
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

INDIAN VCP R1: Voluntary Cleanup Priority Listing
A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 07/27/2015
Date Data Arrived at EDR: 09/29/2015
Date Made Active in Reports: 02/18/2016
Number of Days to Update: 142

Source: EPA, Region 1
Telephone: 617-918-1102
Last EDR Contact: 06/14/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Varies

VCP NYC: Voluntary Cleanup Program Listing NYC
New York City voluntary cleanup program sites.

Date of Government Version: 03/04/2024
Date Data Arrived at EDR: 03/06/2024
Date Made Active in Reports: 05/30/2024
Number of Days to Update: 85

Source: New York City Office of Environmental Protection
Telephone: 212-788-8841
Last EDR Contact: 06/05/2024
Next Scheduled EDR Contact: 09/16/2024
Data Release Frequency: Varies

Lists of state and tribal brownfield sites

BROWNFIELDS: Brownfields Site List
A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant.

Date of Government Version: 08/01/2024
Date Data Arrived at EDR: 08/01/2024
Date Made Active in Reports: 08/05/2024
Number of Days to Update: 4

Source: Department of Environmental Conservation
Telephone: 518-402-9764
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Semi-Annually

ERP: Environmental Restoration Program Listing
In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a $200 million Environmental Restoration or Brownfields Fund as part of the $1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

Date of Government Version: 08/01/2024
Date Data Arrived at EDR: 08/01/2024
Date Made Active in Reports: 08/05/2024
Number of Days to Update: 4

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 03/11/2024
Date Data Arrived at EDR: 03/12/2024
Date Made Active in Reports: 05/10/2024
Number of Days to Update: 59

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 06/11/2024
Next Scheduled EDR Contact: 09/23/2024
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

SWRCY: Registered Recycling Facility List

A listing of recycling facilities.

Date of Government Version: 03/25/2024
Date Data Arrived at EDR: 03/27/2024
Date Made Active in Reports: 06/18/2024
Number of Days to Update: 83

Source: Department of Environmental Conservation
Telephone: 518-402-8678
Last EDR Contact: 06/21/2024
Next Scheduled EDR Contact: 10/07/2024
Data Release Frequency: Quarterly

SWTIRE: Registered Waste Tire Storage & Facility List

A listing of facilities registered to accept waste tires.

Date of Government Version: 02/27/2018
Date Data Arrived at EDR: 04/06/2018
Date Made Active in Reports: 06/08/2018
Number of Days to Update: 63

Source: Department of Environmental Conservation
Telephone: 518-402-8694
Last EDR Contact: 05/31/2024
Next Scheduled EDR Contact: 09/16/2024
Data Release Frequency: No Update Planned

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52

Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 07/22/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: Varies

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137

Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: No Update Planned

IHS OPEN DUMPS: Open Dumps on Indian Land

A listing of all open dumps located on Indian Land in the United States.

Date of Government Version: 04/01/2014
Date Data Arrived at EDR: 08/06/2014
Date Made Active in Reports: 01/29/2015
Number of Days to Update: 176

Source: Department of Health & Human Serivces, Indian Health Service
Telephone: 301-443-1452
Last EDR Contact: 07/18/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations that have been removed from the DEAs National Clandestine Laboratory Register.

Date of Government Version: 05/20/2024
Date Data Arrived at EDR: 05/21/2024
Date Made Active in Reports: 08/08/2024
Number of Days to Update: 79

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 08/19/2024
Next Scheduled EDR Contact: 12/02/2024
Data Release Frequency: No Update Planned

DEL SHWS: Delisted Registry Sites

A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

Date of Government Version: 08/01/2024
Date Data Arrived at EDR: 08/01/2024
Date Made Active in Reports: 08/05/2024
Number of Days to Update: 4

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Quarterly

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 05/20/2024
Date Data Arrived at EDR: 05/21/2024
Date Made Active in Reports: 08/08/2024
Number of Days to Update: 79

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 08/19/2024
Next Scheduled EDR Contact: 12/02/2024
Data Release Frequency: Quarterly

Local Lists of Registered Storage Tanks

HIST UST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. It is no longer updated due to the sensitive nature of the information involved. See UST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: Varies

HIST AST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capabilities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. No longer updated due to the sensitive nature of the information involved. See AST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: No Update Planned

Local Land Records

LIENS: Spill Liens Information

Lien information from the Oil Spill Fund.

Date of Government Version: 04/19/2024
Date Data Arrived at EDR: 04/19/2024
Date Made Active in Reports: 06/26/2024
Number of Days to Update: 68

Source: Office of the State Comptroller
Telephone: 518-474-9034
Last EDR Contact: 07/24/2024
Next Scheduled EDR Contact: 11/11/2024
Data Release Frequency: Quarterly

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 05/22/2024
Date Data Arrived at EDR: 06/03/2024
Date Made Active in Reports: 06/26/2024
Number of Days to Update: 23

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 10/07/2024
Data Release Frequency: Semi-Annually

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 06/14/2024
Date Data Arrived at EDR: 06/17/2024
Date Made Active in Reports: 06/24/2024
Number of Days to Update: 7

Source: U.S. Department of Transportation
Telephone: 202-366-4555
Last EDR Contact: 06/17/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Quarterly

SPILLS: Spills Information Database

Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 07/30/2024
Date Data Arrived at EDR: 07/31/2024
Date Made Active in Reports: 08/05/2024
Number of Days to Update: 5

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/31/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Varies

HIST SPILLS: SPILLS Database

This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 07/08/2005
Date Made Active in Reports: 07/14/2005
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/07/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 12/14/2012
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 02/12/2013
Number of Days to Update: 40

Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

SPILLS 80: SPILLS80 data from FirstSearch

Spills 80 includes those spill and release records available from FirstSearch databases prior to 1990. Typically, they may include chemical, oil and/or hazardous substance spills recorded before 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 80.

Date of Government Version: 11/02/2010
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 03/07/2013
Number of Days to Update: 63

Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 06/03/2024
Date Data Arrived at EDR: 06/07/2024
Date Made Active in Reports: 06/20/2024
Number of Days to Update: 13

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 06/07/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Quarterly

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 05/13/2024
Date Data Arrived at EDR: 05/14/2024
Date Made Active in Reports: 08/08/2024
Number of Days to Update: 86

Source: U.S. Army Corps of Engineers
Telephone: 202-528-4285
Last EDR Contact: 08/12/2024
Next Scheduled EDR Contact: 11/26/2024
Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 06/07/2021
Date Data Arrived at EDR: 07/13/2021
Date Made Active in Reports: 03/09/2022
Number of Days to Update: 239

Source: USGS
Telephone: 888-275-8747
Last EDR Contact: 07/11/2024
Next Scheduled EDR Contact: 10/21/2024
Data Release Frequency: Varies

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 04/02/2018
Date Data Arrived at EDR: 04/11/2018
Date Made Active in Reports: 11/06/2019
Number of Days to Update: 574

Source: U.S. Geological Survey
Telephone: 888-275-8747
Last EDR Contact: 07/02/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: N/A

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 07/30/2021
Date Data Arrived at EDR: 02/03/2023
Date Made Active in Reports: 02/10/2023
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 08/05/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 03/18/2024
Date Data Arrived at EDR: 03/19/2024
Date Made Active in Reports: 06/20/2024
Number of Days to Update: 93

Source: Environmental Protection Agency
Telephone: 202-566-1917
Last EDR Contact: 06/17/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Quarterly

EPA WATCH LIST: EPA Watch List

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 08/30/2013
Date Data Arrived at EDR: 03/21/2014
Date Made Active in Reports: 06/17/2014
Number of Days to Update: 88

Source: Environmental Protection Agency
Telephone: 617-520-3000
Last EDR Contact: 07/25/2024
Next Scheduled EDR Contact: 11/11/2024
Data Release Frequency: No Update Planned

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 09/30/2017
Date Data Arrived at EDR: 05/08/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 73

Source: Environmental Protection Agency
Telephone: 703-308-4044
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 11/11/2024
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2020
Date Data Arrived at EDR: 06/14/2022
Date Made Active in Reports: 03/24/2023
Number of Days to Update: 283

Source: EPA
Telephone: 202-260-5521
Last EDR Contact: 06/13/2024
Next Scheduled EDR Contact: 09/23/2024
Data Release Frequency: Every 4 Years

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2022
Date Data Arrived at EDR: 11/13/2023
Date Made Active in Reports: 02/07/2024
Number of Days to Update: 86

Source: EPA
Telephone: 202-566-0250
Last EDR Contact: 08/15/2024
Next Scheduled EDR Contact: 11/26/2024
Data Release Frequency: Annually

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 07/11/2024
Date Data Arrived at EDR: 07/11/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 1

Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 07/11/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Annually

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 05/22/2024
Date Data Arrived at EDR: 06/03/2024
Date Made Active in Reports: 06/26/2024
Number of Days to Update: 23

Source: EPA
Telephone: 703-416-0223
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 09/09/2024
Data Release Frequency: Annually

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 04/01/2024
Date Data Arrived at EDR: 04/17/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 86

Source: Environmental Protection Agency
Telephone: 202-564-8600
Last EDR Contact: 07/11/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995
Date Data Arrived at EDR: 07/03/1995
Date Made Active in Reports: 08/07/1995
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-4104
Last EDR Contact: 06/02/2008
Next Scheduled EDR Contact: 09/01/2008
Data Release Frequency: No Update Planned

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 09/19/2023
Date Data Arrived at EDR: 10/03/2023
Date Made Active in Reports: 10/19/2023
Number of Days to Update: 16

Source: EPA
Telephone: 202-564-6023
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 11/11/2024
Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 03/20/2023
Date Data Arrived at EDR: 04/04/2023
Date Made Active in Reports: 06/09/2023
Number of Days to Update: 66

Source: EPA
Telephone: 202-566-0500
Last EDR Contact: 07/02/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 11/18/2016
Date Data Arrived at EDR: 11/23/2016
Date Made Active in Reports: 02/10/2017
Number of Days to Update: 79

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 06/26/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25
Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Telephone: 202-566-1667
Last EDR Contact: 08/18/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: No Update Planned

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25
Source: EPA
Telephone: 202-566-1667
Last EDR Contact: 08/18/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: No Update Planned

MLTS: Material Licensing Tracking System
MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 01/02/2024
Date Data Arrived at EDR: 01/16/2024
Date Made Active in Reports: 03/13/2024
Number of Days to Update: 57
Source: Nuclear Regulatory Commission
Telephone: 301-415-0717
Last EDR Contact: 07/11/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Quarterly

COAL ASH DOE: Steam-Electric Plant Operation Data
A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2022
Date Data Arrived at EDR: 11/27/2023
Date Made Active in Reports: 02/22/2024
Number of Days to Update: 87
Source: Department of Energy
Telephone: 202-586-8719
Last EDR Contact: 05/28/2024
Next Scheduled EDR Contact: 09/09/2024
Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List
A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 01/12/2017
Date Data Arrived at EDR: 03/05/2019
Date Made Active in Reports: 11/11/2019
Number of Days to Update: 251
Source: Environmental Protection Agency
Telephone: N/A
Last EDR Contact: 08/22/2024
Next Scheduled EDR Contact: 12/09/2024
Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database
The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 09/13/2019
Date Data Arrived at EDR: 11/06/2019
Date Made Active in Reports: 02/10/2020
Number of Days to Update: 96
Source: Environmental Protection Agency
Telephone: 202-566-0517
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 11/11/2024
Data Release Frequency: Varies

RADINFO: Radiation Information Database
The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 07/01/2019
Date Data Arrived at EDR: 07/01/2019
Date Made Active in Reports: 09/23/2019
Number of Days to Update: 84

Source: Environmental Protection Agency
Telephone: 202-343-9775
Last EDR Contact: 06/21/2024
Next Scheduled EDR Contact: 10/07/2024
Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2007
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

DOT OPS: Incident and Accident Data

Department of Transporation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 01/02/2020
Date Data Arrived at EDR: 01/28/2020
Date Made Active in Reports: 04/17/2020
Number of Days to Update: 80

Source: Department of Transporation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 07/23/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: Quarterly

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 03/31/2024
Date Data Arrived at EDR: 04/19/2024
Date Made Active in Reports: 06/26/2024
Number of Days to Update: 68

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 06/26/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2021
Date Data Arrived at EDR: 03/09/2023
Date Made Active in Reports: 03/20/2023
Number of Days to Update: 11

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 06/07/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Biennially

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 07/14/2015
Date Made Active in Reports: 01/10/2017
Number of Days to Update: 546

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 07/02/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Semi-Annually

FUSRAP: Formerly Utilized Sites Remedial Action Program

DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations.

Date of Government Version: 03/03/2023
Date Data Arrived at EDR: 03/03/2023
Date Made Active in Reports: 06/09/2023
Number of Days to Update: 98

Source: Department of Energy
Telephone: 202-586-3559
Last EDR Contact: 07/24/2024
Next Scheduled EDR Contact: 11/11/2024
Data Release Frequency: Varies

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 08/30/2019
Date Data Arrived at EDR: 11/15/2019
Date Made Active in Reports: 01/28/2020
Number of Days to Update: 74

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 08/08/2024
Next Scheduled EDR Contact: 11/26/2024
Data Release Frequency: Varies

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 05/22/2024
Date Data Arrived at EDR: 06/03/2024
Date Made Active in Reports: 06/24/2024
Number of Days to Update: 21

Source: Environmental Protection Agency
Telephone: 703-603-8787
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 10/07/2024
Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931and 1964. These sites may pose a threat to public health through ingestion or inhalation of contaminated soil or dust

Date of Government Version: 04/05/2001
Date Data Arrived at EDR: 10/27/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 36

Source: American Journal of Public Health
Telephone: 703-305-6451
Last EDR Contact: 12/02/2009
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)

The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US AIRS MINOR: Air Facility System Data

A listing of minor source facilities.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 08/06/2024
Date Data Arrived at EDR: 08/14/2024
Date Made Active in Reports: 08/15/2024
Number of Days to Update: 1

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 08/14/2024
Next Scheduled EDR Contact: 12/02/2024
Data Release Frequency: Semi-Annually

MINES VIOLATIONS: MSHA Violation Assessment Data

Mines violation and assessment information. Department of Labor, Mine Safety & Health Administration.

Date of Government Version: 04/01/2024
Date Data Arrived at EDR: 04/04/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 99

Source: DOL, Mine Safety & Health Admi
Telephone: 202-693-9424
Last EDR Contact: 07/02/2024
Next Scheduled EDR Contact: 12/02/2024
Data Release Frequency: Quarterly

US MINES 2: Ferrous and Nonferrous Metal Mines Database Listing

This map layer includes ferrous (ferrous metal mines are facilities that extract ferrous metals, such as iron ore or molybdenum) and nonferrous (Nonferrous metal mines are facilities that extract nonferrous metals, such as gold, silver, copper, zinc, and lead) metal mines in the United States.

Date of Government Version: 04/15/2024
Date Data Arrived at EDR: 05/22/2024
Date Made Active in Reports: 08/15/2024
Number of Days to Update: 85

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 08/20/2024
Next Scheduled EDR Contact: 12/02/2024
Data Release Frequency: Varies

US MINES 3: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011
Date Data Arrived at EDR: 06/08/2011
Date Made Active in Reports: 09/13/2011
Number of Days to Update: 97

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 08/22/2024
Next Scheduled EDR Contact: 12/02/2024
Data Release Frequency: Varies

ABANDONED MINES: Abandoned Mines

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by OSMRE to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

Date of Government Version: 03/18/2024
Date Data Arrived at EDR: 03/19/2024
Date Made Active in Reports: 06/06/2024
Number of Days to Update: 79

Source: Department of Interior
Telephone: 202-208-2609
Last EDR Contact: 06/13/2024
Next Scheduled EDR Contact: 09/16/2024
Data Release Frequency: Quarterly

MINES MRDS: Mineral Resources Data System
Mineral Resources Data System

Date of Government Version: 08/23/2022
Date Data Arrived at EDR: 11/22/2022
Date Made Active in Reports: 02/28/2023
Number of Days to Update: 98

Source: USGS
Telephone: 703-648-6533
Last EDR Contact: 08/22/2024
Next Scheduled EDR Contact: 12/02/2024
Data Release Frequency: Varies

FINDS: Facility Index System/Facility Registry System
Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 02/09/2024
Date Data Arrived at EDR: 02/27/2024
Date Made Active in Reports: 05/24/2024
Number of Days to Update: 87

Source: EPA
Telephone: (212) 637-3000
Last EDR Contact: 08/20/2024
Next Scheduled EDR Contact: 12/09/2024
Data Release Frequency: Quarterly

UXO: Unexploded Ordnance Sites
A listing of unexploded ordnance site locations

Date of Government Version: 09/06/2023
Date Data Arrived at EDR: 09/13/2023
Date Made Active in Reports: 12/11/2023
Number of Days to Update: 89

Source: Department of Defense
Telephone: 703-704-1564
Last EDR Contact: 07/08/2024
Next Scheduled EDR Contact: 10/21/2024
Data Release Frequency: Varies

ECHO: Enforcement & Compliance History Information
ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

Date of Government Version: 06/23/2024
Date Data Arrived at EDR: 06/28/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 14

Source: Environmental Protection Agency
Telephone: 202-564-2280
Last EDR Contact: 06/28/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Quarterly

DOCKET HWC: Hazardous Waste Compliance Docket Listing
A complete list of the Federal Agency Hazardous Waste Compliance Docket Facilities.

Date of Government Version: 05/06/2021
Date Data Arrived at EDR: 05/21/2021
Date Made Active in Reports: 08/11/2021
Number of Days to Update: 82

Source: Environmental Protection Agency
Telephone: 202-564-0527
Last EDR Contact: 08/13/2024
Next Scheduled EDR Contact: 12/02/2024
Data Release Frequency: Varies

FUELS PROGRAM: EPA Fuels Program Registered Listing
This listing includes facilities that are registered under the Part 80 (Code of Federal Regulations) EPA Fuels Programs. All companies now are required to submit new and updated registrations.

Date of Government Version: 05/13/2024
Date Data Arrived at EDR: 05/14/2024
Date Made Active in Reports: 08/08/2024
Number of Days to Update: 86

Source: EPA
Telephone: 800-385-6164
Last EDR Contact: 08/13/2024
Next Scheduled EDR Contact: 11/26/2024
Data Release Frequency: Quarterly

PFAS NPL: Superfund Sites with PFAS Detections Information

EPA's Office of Land and Emergency Management and EPA Regional Offices maintain data describing what is known about site investigations, contamination, and remedial actions under the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) where PFAS is present in the environment.

Date of Government Version: 07/01/2024
Date Data Arrived at EDR: 07/01/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 11

Source: Environmental Protection Agency
Telephone: 703-603-8895
Last EDR Contact: 07/01/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

PFAS FEDERAL SITES: Federal Sites PFAS Information

Several federal entities, such as the federal Superfund program, Department of Defense, National Aeronautics and Space Administration, Department of Transportation, and Department of Energy provided information for sites with known or suspected detections at federal facilities.

Date of Government Version: 07/01/2024
Date Data Arrived at EDR: 07/01/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 11

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 07/01/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

PFAS TRIS: List of PFAS Added to the TRI

Section 7321 of the National Defense Authorization Act for Fiscal Year 2020 (NDAA) immediately added certain per- and polyfluoroalkyl substances (PFAS) to the list of chemicals covered by the Toxics Release Inventory (TRI) under Section 313 of the Emergency Planning and Community Right-to-Know Act (EPCRA) and provided a framework for additional PFAS to be added to TRI on an annual basis.

Date of Government Version: 07/01/2024
Date Data Arrived at EDR: 07/01/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 11

Source: Environmental Protection Agency
Telephone: 202-566-0250
Last EDR Contact: 07/01/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

PFAS TSCA: PFAS Manufacture and Imports Information

EPA issued the Chemical Data Reporting (CDR) Rule under the Toxic Substances Control Act (TSCA) and requires chemical manufacturers and facilities that manufacture or import chemical substances to report data to EPA. EPA publishes non-confidential business information (non-CBI) and includes descriptive information about each site, corporate parent, production volume, other manufacturing information, and processing and use information.

Date of Government Version: 07/01/2024
Date Data Arrived at EDR: 07/01/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 11

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 07/01/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

PFAS RCRA MANIFEST: PFAS Transfers Identified In the RCRA Database Listing

To work around the lack of PFAS waste codes in the RCRA database, EPA developed the PFAS Transfers dataset by mining e-Manifest records containing at least one of these common PFAS keywords: PFAS, PFOA, PFOS, PERFL, AFFF, GENX, GEN-X (plus the VT waste codes). These keywords were searched for in the following text fields: Manifest handling instructions (MANIFEST_HANDLING_INSTR), Non-hazardous waste description (NON_HAZ_WASTE_DESCRIPTION), DOT printed information (DOT_PRINTED_INFORMATION), Waste line handling instructions (WASTE_LINE_HANDLING_INSTR), Waste residue comments (WASTE_RESIDUE_COMMENTS).

Date of Government Version: 07/01/2024
Date Data Arrived at EDR: 07/01/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 11

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 07/01/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

PFAS ATSDR: PFAS Contamination Site Location Listing

PFAS contamination site locations from the Department of Health & Human Services, Center for Disease Control & Prevention. ATSDR is involved at a number of PFAS-related sites, either directly or through assisting state and federal partners. As of now, most sites are related to drinking water contamination connected with PFAS production facilities or fire training areas where aqueous film-forming firefighting foam (AFFF) was regularly used.

Date of Government Version: 06/24/2020
Date Data Arrived at EDR: 03/17/2021
Date Made Active in Reports: 11/08/2022
Number of Days to Update: 601

Source: Department of Health & Human Services
Telephone: 202-741-5770
Last EDR Contact: 07/18/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: Varies

PFAS WQP: Ambient Environmental Sampling for PFAS

The Water Quality Portal (WQP) is a part of a modernized repository storing ambient sampling data for all environmental media and tissue samples. A wide range of federal, state, tribal and local governments, academic and non-governmental organizations and individuals submit project details and sampling results to this public repository. The information is commonly used for research and assessments of environmental quality.

Date of Government Version: 07/01/2024
Date Data Arrived at EDR: 07/01/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 11

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 07/01/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

PFAS PROJECT: NORTHEASTERN UNIVERSITY PFAS PROJECT

The PFAS Contamination Site Tracker records qualitative and quantitative data from each site in a chart, specifically examining discovery, contamination levels, government response, litigation, health impacts, media coverage, and community characteristics. All data presented in the chart were extracted from government websites, such as state health departments or the Environmental Protection Agency, and news articles.

Date of Government Version: 05/19/2023
Date Data Arrived at EDR: 04/05/2024
Date Made Active in Reports: 06/06/2024
Number of Days to Update: 62

Source: Social Science Environmental Health Research Institute
Telephone: N/A
Last EDR Contact: 06/04/2024
Next Scheduled EDR Contact: 09/16/2024
Data Release Frequency: Varies

PFAS NPDES: Clean Water Act Discharge Monitoring Information

Any discharger of pollutants to waters of the United States from a point source must have a National Pollutant Discharge Elimination System (NPDES) permit. The process for obtaining limits involves the regulated entity (permittee) disclosing releases in a NPDES permit application and the permitting authority (typically the state but sometimes EPA) deciding whether to require monitoring or monitoring with limits. Caveats and Limitations: Less than half of states have required PFAS monitoring for at least one of their permittees and fewer states have established PFAS effluent limits for permittees. New rulemakings have been initiated that may increase the number of facilities monitoring for PFAS in the future.

Date of Government Version: 07/01/2024
Date Data Arrived at EDR: 07/01/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 11

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 07/01/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

PFAS ECHO: Facilities in Industries that May Be Handling PFAS Listing

Regulators and the public have expressed interest in knowing which regulated entities may be using PFAS. EPA has developed a dataset from various sources that show which industries may be handling PFAS. Approximately 120,000 facilities subject to federal environmental programs have operated or currently operate in industry sectors with processes that may involve handling and/or release of PFAS.

Date of Government Version: 07/01/2024
Date Data Arrived at EDR: 07/01/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 11

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 07/01/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

PFAS ECHO FIRE TRAIN: Facilities in Industries that May Be Handling PFAS Listing

A list of fire training sites was added to the Industry Sectors dataset using a keyword search on the permitted facilitys name to identify sites where fire-fighting foam may have been used in training exercises. Additionally, you may view an example spreadsheet of the subset of fire training facility data, as well as the keywords used in selecting or deselecting a facility for the subset. as well as the keywords used in selecting or deselecting a facility for the subset. These keywords were tested to maximize accuracy in selecting facilities that may use fire-fighting foam in training exercises, however, due to the lack of a required reporting field in the data systems for designating fire training sites, this methodology may not identify all fire training sites or may potentially misidentify them.

Date of Government Version: 07/01/2024
Date Data Arrived at EDR: 07/01/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 11

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 07/01/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

PFAS PT 139 AIRPORT: All Certified Part 139 Airports PFAS Information Listing

Since July 1, 2006, all certified part 139 airports are required to have fire-fighting foam onsite that meet military specifications (MIL-F-24385) (14 CFR 139.317). To date, these military specification fire-fighting foams are fluorinated and have been historically used for training and extinguishing. The 2018 FAA Reauthorization Act has a provision stating that no later than October 2021, FAA shall not require the use of fluorinated AFFF. This provision does not prohibit the use of fluorinated AFFF at Part 139 civilian airports; it only prohibits FAA from mandating its use. The Federal Aviation Administration?s document AC 150/5210-6D - Aircraft Fire Extinguishing Agents provides guidance on Aircraft Fire Extinguishing Agents, which includes Aqueous Film Forming Foam (AFFF).

Date of Government Version: 07/01/2024
Date Data Arrived at EDR: 07/01/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 11

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 07/01/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

AQUEOUS FOAM NRC: Aqueous Foam Related Incidents Listing

The National Response Center (NRC) serves as an emergency call center that fields initial reports for pollution and railroad incidents and forwards that information to appropriate federal/state agencies for response. The spreadsheets posted to the NRC website contain initial incident data that has not been validated or investigated by a federal/state response agency. Response center calls from 1990 to the most recent complete calendar year where there was indication of Aqueous Film Forming Foam (AFFF) usage are included in this dataset. NRC calls may reference AFFF usage in the ?Material Involved? or ?Incident Description? fields.

Date of Government Version: 07/01/2024
Date Data Arrived at EDR: 07/01/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 11

Source: Environmental Protection Agency
Telephone: 202-267-2675
Last EDR Contact: 07/01/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

PCS: Permit Compliance System

PCS is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

Date of Government Version: 12/16/2016
Date Data Arrived at EDR: 01/06/2017
Date Made Active in Reports: 03/10/2017
Number of Days to Update: 63

Source: EPA, Office of Water
Telephone: 202-564-2496
Last EDR Contact: 06/27/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: No Update Planned

PCS ENF: Enforcement data
No description is available for this data

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 02/05/2015
Date Made Active in Reports: 03/06/2015
Number of Days to Update: 29

Source: EPA
Telephone: 202-564-2497
Last EDR Contact: 06/27/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Varies

BIOSOLIDS: ICIS-NPDES Biosolids Facility Data
The data reflects compliance information about facilities in the biosolids program.

Date of Government Version: 04/14/2024
Date Data Arrived at EDR: 04/16/2024
Date Made Active in Reports: 07/12/2024
Number of Days to Update: 87

Source: Environmental Protection Agency
Telephone: 202-564-4700
Last EDR Contact: 07/16/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Varies

UST FINDER RELEASE: UST Finder Releases Database
US EPA's UST Finder data is a national composite of leaking underground storage tanks. This data contains information about, and locations of, leaking underground storage tanks. Data was collected from state sources and standardized into a national profile by EPA's Office of Underground Storage Tanks, Office of Research and Development, and the Association of State and Territorial Solid Waste Management Officials.

Date of Government Version: 06/08/2023
Date Data Arrived at EDR: 10/31/2023
Date Made Active in Reports: 01/18/2024
Number of Days to Update: 79

Source: Environmental Protecton Agency
Telephone: 202-564-0394
Last EDR Contact: 08/08/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Semi-Annually

UST FINDER: UST Finder Database
EPA developed UST Finder, a web map application containing a comprehensive, state-sourced national map of underground storage tank (UST) and leaking UST (LUST) data. It provides the attributes and locations of active and closed USTs, UST facilities, and LUST sites from states and from Tribal lands and US territories . UST Finder contains information about proximity of UST facilities and LUST sites to: surface and groundwater public drinking water protection areas; estimated number of private domestic wells and number of people living nearby; and flooding and wildfires.

Date of Government Version: 06/08/2023
Date Data Arrived at EDR: 10/04/2023
Date Made Active in Reports: 01/18/2024
Number of Days to Update: 106

Source: Environmental Protection Agency
Telephone: 202-564-0394
Last EDR Contact: 08/08/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Varies

E MANIFEST: Hazardous Waste Electronic Manifest System
EPA established a national system for tracking hazardous waste shipments electronically. This system, known as ?e-Manifest,? will modernize the nation?s cradle-to-grave hazardous waste tracking process while saving valuable time, resources, and dollars for industry and states.

Date of Government Version: 07/24/2023
Date Data Arrived at EDR: 04/18/2024
Date Made Active in Reports: 06/06/2024
Number of Days to Update: 49

Source: Environmental Protection Agency
Telephone: 833-501-6826
Last EDR Contact: 06/07/2024
Next Scheduled EDR Contact: 09/30/2024
Data Release Frequency: Varies

PFAS: PFAS Contamination Site Location Listing
DEC surveyed select businesses, fire departments, fire training centers, bulk storage facilities, airports, and Department of Defense (DoD) facilities. The responses to the survey have helped to determine if these entities used or stored materials containing PFOA/PFOS including AFFF and dispersants used in Teflon coating operations. The results of this survey will be updated periodically as additional responses are received..

Date of Government Version: 01/16/2019
Date Data Arrived at EDR: 05/08/2019
Date Made Active in Reports: 06/24/2019
Number of Days to Update: 47

Source: Department of Environmental Conservation
Telephone: 518-402-9020
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 11/11/2024
Data Release Frequency: Varies

PFAS 2: New York State Inactive Landfill Initiative

A list of landfills that were investigated and the analytical results for PFOA and PFOS for those landfills. These data represent the landfills from the ILI database that were investigated.

Date of Government Version: 12/12/2022
Date Data Arrived at EDR: 08/10/2023
Date Made Active in Reports: 10/25/2023
Number of Days to Update: 76

Source: Department of Environmental Conservation
Telephone: 518-402-9662
Last EDR Contact: 07/24/2024
Next Scheduled EDR Contact: 11/11/2024
Data Release Frequency: Varies

PFAS 3: PFAS Environmental Site Remediation List

A list of records included in the Environmental Remediation database whose material is listed as Perfluorooctanoic Acid or Perfluorooctane Sulfonic Acid.

Date of Government Version: 08/01/2024
Date Data Arrived at EDR: 08/01/2024
Date Made Active in Reports: 08/05/2024
Number of Days to Update: 4

Source: Department of Environmental Conservation
Telephone: 518-402-9759
Last EDR Contact: 08/01/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Varies

AIRS: Air Emissions Data

Point source emissions inventory data.

Date of Government Version: 05/06/2024
Date Data Arrived at EDR: 05/09/2024
Date Made Active in Reports: 08/06/2024
Number of Days to Update: 89

Source: Department of Environmental Conservation
Telephone: 518-402-8452
Last EDR Contact: 07/11/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: Annually

COAL ASH: Coal Ash Disposal Site Listing

A listing of coal ash disposal site locations.

Date of Government Version: 03/26/2024
Date Data Arrived at EDR: 03/27/2024
Date Made Active in Reports: 06/21/2024
Number of Days to Update: 86

Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 06/21/2024
Next Scheduled EDR Contact: 10/07/2024
Data Release Frequency: Quarterly

DRYCLEANERS: Registered Drycleaners

A listing of all registered drycleaning facilities.

Date of Government Version: 03/06/2024
Date Data Arrived at EDR: 03/08/2024
Date Made Active in Reports: 05/29/2024
Number of Days to Update: 82

Source: Department of Environmental Conservation
Telephone: 518-402-8403
Last EDR Contact: 05/31/2024
Next Scheduled EDR Contact: 09/16/2024
Data Release Frequency: Annually

E DESIGNATION: E DESIGNATION SITE LISTING

The (E (Environmental)) designation would ensure that sampling and remediation take place on the subject properties, and would avoid any significant impacts related to hazardous materials at these locations. The (E) designations would require that the fee owner of the sites conduct a testing and sampling protocol, and remediation where appropriate, to the satisfaction of the NYCDEP before the issuance of a building permit by the Department of Buildings pursuant to the provisions of Section 11-15 of the Zoning Resolution (Environmental Requirements). The (E) designations also include a mandatory construction-related health and safety plan which must be approved by NYCDEP.

Date of Government Version: 03/05/2024
Date Data Arrived at EDR: 03/13/2024
Date Made Active in Reports: 06/05/2024
Number of Days to Update: 84

Source: New York City Department of City Planning
Telephone: 718-595-6658
Last EDR Contact: 06/12/2024
Next Scheduled EDR Contact: 09/23/2024
Data Release Frequency: Semi-Annually

FIN ASSURANCE 1: Financial Assurance Information Listing

Financial assurance information.

Date of Government Version: 03/27/2024
Date Data Arrived at EDR: 03/28/2024
Date Made Active in Reports: 06/18/2024
Number of Days to Update: 82

Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 06/21/2024
Next Scheduled EDR Contact: 10/07/2024
Data Release Frequency: Quarterly

FIN ASSURANCE 2: Financial Assurance Information Listing

A listing of financial assurance information for hazardous waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 03/07/2024
Date Data Arrived at EDR: 03/14/2024
Date Made Active in Reports: 03/20/2024
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-8712
Last EDR Contact: 05/31/2024
Next Scheduled EDR Contact: 09/16/2024
Data Release Frequency: Varies

HSWDS: Hazardous Substance Waste Disposal Site Inventory

The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-Registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The last version of the study inventory is frozen in time. The sites on the study will not automatically be made Superfund sites, rather each site will be further evaluated for listing on the Registry. So overtime they will be added to the registry or not.

Date of Government Version: 01/01/2003
Date Data Arrived at EDR: 10/20/2006
Date Made Active in Reports: 11/30/2006
Number of Days to Update: 41

Source: Department of Environmental Conservation
Telephone: 518-402-9564
Last EDR Contact: 05/26/2009
Next Scheduled EDR Contact: 08/24/2009
Data Release Frequency: No Update Planned

NYC LEAD: Lead-based Paint Testing Results

The results of the inspections for all classrooms serving students under six in applicable buildings. Identifies all classrooms, whether there was observation of peeling paint, and if there was, standard response protocol was followed.

Date of Government Version: 12/31/2023
Date Data Arrived at EDR: 01/31/2024
Date Made Active in Reports: 04/22/2024
Number of Days to Update: 82

Source: New York City Department of Education
Telephone: 212-374-5141
Last EDR Contact: 07/30/2024
Next Scheduled EDR Contact: 11/11/2024
Data Release Frequency: Varies

NYC LEAD 2: Recent Lead Paint Violations

Pursuant to New York City?s Housing Maintenance Code, the Department of Housing Preservation and Development (HPD) issues violations against conditions in rental dwelling units that have been verified to violate the New York City Housing Maintenance Code (HMC) or the New York State Multiple Dwelling Law (MDL). Violations are issued when an inspection verifies that a violation of the HMC or MDL exists. It is closed when the violation is corrected, as observed/verified by HPD or as certified by the landlord.

Date of Government Version: 04/29/2024
Date Data Arrived at EDR: 05/01/2024
Date Made Active in Reports: 07/25/2024
Number of Days to Update: 85

Source: New York City Department of Housing Preservation & Development
Telephone: 212-863-8200
Last EDR Contact: 07/30/2024
Next Scheduled EDR Contact: 11/11/2024
Data Release Frequency: Varies

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 12/31/2019
Date Data Arrived at EDR: 11/30/2023
Date Made Active in Reports: 12/01/2023
Number of Days to Update: 1

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 07/25/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: Quarterly

SPDES: State Pollutant Discharge Elimination System

New York State has a state program which has been approved by the United States Environmental Protection Agency for the control of wastewater and stormwater discharges in accordance with the Clean Water Act. Under New York State law the program is known as the State Pollutant Discharge Elimination System (SPDES) and is broader in scope than that required by the Clean Water Act in that it controls point source discharges to groundwaters as well as surface waters.

Date of Government Version: 04/12/2024
Date Data Arrived at EDR: 05/09/2024
Date Made Active in Reports: 08/06/2024
Number of Days to Update: 89

Source: Department of Environmental Conservation
Telephone: 518-402-8233
Last EDR Contact: 07/11/2024
Next Scheduled EDR Contact: 10/28/2024
Data Release Frequency: No Update Planned

VAPOR REOPENED: Vapor Intrusion Legacy Site List

New York is currently re-evaluating previous assumptions and decisions regarding the potential for soil vapor intrusion exposures at sites. As a result, all past, current, and future contaminated sites will be evaluated to determine whether these sites have the potential for exposures related to soil vapor intrusion.

Date of Government Version: 01/01/2022
Date Data Arrived at EDR: 02/08/2022
Date Made Active in Reports: 05/06/2022
Number of Days to Update: 87

Source: Department of Environmenal Conservation
Telephone: 518-402-9814
Last EDR Contact: 08/08/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: Varies

UIC: Underground Injection Control Wells

A listing of enhanced oil recovery underground injection wells.

Date of Government Version: 05/27/2024
Date Data Arrived at EDR: 05/30/2024
Date Made Active in Reports: 08/26/2024
Number of Days to Update: 88

Source: Department of Environmental Conservation
Telephone: 518-402-8056
Last EDR Contact: 05/30/2024
Next Scheduled EDR Contact: 09/09/2024
Data Release Frequency: Quarterly

COOLING TOWERS: Registered Cooling Towers

This data includes the location of cooling towers registered with New York State. The data is self-reported by owners/property managers of cooling towers in service in New York State. In August 2015, the New York State Department of Health released emergency regulations requiring the owners of cooling towers to register them with New York State.

Date of Government Version: 04/02/2024
Date Data Arrived at EDR: 04/10/2024
Date Made Active in Reports: 07/09/2024
Number of Days to Update: 90

Source: Department of Health
Telephone: 518-402-7650
Last EDR Contact: 07/10/2024
Next Scheduled EDR Contact: 10/21/2024
Data Release Frequency: Varies

ILI: New York State Inactive Landfill Initiative

A solid waste site priority list of mitigation and remedial activities to address sites causing, or substantially contributing to, impairments of drinking water quality. Inactive solid waste disposal sites, primarily landfills, and their potential impact on New York?s drinking water resources from site-related contaminants, with a focus on emerging contaminants.

Date of Government Version: 05/16/2024
Date Data Arrived at EDR: 05/30/2024
Date Made Active in Reports: 08/26/2024
Number of Days to Update: 88

Source: Department of Environmental Conservation
Telephone: 518-402-8671
Last EDR Contact: 07/24/2024
Next Scheduled EDR Contact: 11/11/2024
Data Release Frequency: Varies

NYC LAND USE: New York City Land Use Information

Land use colors

Date of Government Version: 05/03/2024
Date Data Arrived at EDR: 06/12/2024
Date Made Active in Reports: 06/28/2024
Number of Days to Update: 16

Source: New York City Department of City Planning
Telephone: 212-720-3300
Last EDR Contact: 06/12/2024
Next Scheduled EDR Contact: 09/23/2024
Data Release Frequency: Varies

MGP: Manufactured Gas Plants Listing

From the late 1800's to the mid 1900's, hundreds of manufactured gas plants across New York State supplied homes and industry with fuel for heating, cooking, and lighting. Today, the New York State DEC is overseeing the investigation and cleanup of contamination left behind from these plants.

Date of Government Version: 03/04/2024
Date Data Arrived at EDR: 03/05/2024
Date Made Active in Reports: 05/24/2024
Number of Days to Update: 80

Source: Department of Environmental Conservation
Telephone: 518-402-9662
Last EDR Contact: 06/26/2024
Next Scheduled EDR Contact: 09/16/2024
Data Release Frequency: Varies

NYC OER: OER Cleanup Sites Listing

Properties remediated under OER's oversight, both in the E-Designation program and the NYC Voluntary Cleanup Program. Includes sites completed and in progress.

Date of Government Version: 03/04/2024
Date Data Arrived at EDR: 03/06/2024
Date Made Active in Reports: 05/29/2024
Number of Days to Update: 84

Source: Office of Environmental Remediation
Telephone: 212-788-8841
Last EDR Contact: 06/05/2024
Next Scheduled EDR Contact: 09/16/2024
Data Release Frequency: Varies

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Hist Auto: EDR Exclusive Historical Auto Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR Hist Cleaner: EDR Exclusive Historical Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS: Recovered Government Archive State Hazardous Waste Facilities List

The EDR Recovered Government Archive State Hazardous Waste database provides a list of SHWS incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Conservation in New York.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 12/30/2013
Number of Days to Update: 182

Source: Department of Environmental Conservation
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Conservation in New York.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/10/2014
Number of Days to Update: 193

Source: Department of Environmental Conservation
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

COUNTY RECORDS

CORTLAND COUNTY:

AST - CORTLAND: Cortland County Storage Tank Listing
A listing of aboveground storage tank sites located in Cortland County.

Date of Government Version: 08/20/2019
Date Data Arrived at EDR: 08/20/2019
Date Made Active in Reports: 10/16/2019
Number of Days to Update: 57

Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 07/17/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: Quarterly

UST - CORTLAND: Cortland County Storage Tank Listing
A listing of underground storage tank sites located in Cortland County.

Date of Government Version: 08/20/2019
Date Data Arrived at EDR: 08/20/2019
Date Made Active in Reports: 10/16/2019
Number of Days to Update: 57

Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 07/17/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: Quarterly

NASSAU COUNTY:

AST - NASSAU: Registered Tank Database
A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 11/27/2023
Date Data Arrived at EDR: 11/28/2023
Date Made Active in Reports: 02/06/2024
Number of Days to Update: 70

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 07/18/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: No Update Planned

AST NCFM: Storage Tank Database
A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 07/17/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: Varies

TANKS NASSAU: Registered Tank Database in Nassau County
A listing of facilities in Nassau County with storage tanks.

Date of Government Version: 11/27/2023
Date Data Arrived at EDR: 11/28/2023
Date Made Active in Reports: 02/06/2024
Number of Days to Update: 70

Source: Nassau County Department of Health
Telephone: 516-227-9691
Last EDR Contact: 07/18/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: No Update Planned

UST - NASSAU: Registered Tank Database
A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 11/27/2023
Date Data Arrived at EDR: 11/28/2023
Date Made Active in Reports: 02/06/2024
Number of Days to Update: 70

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 07/18/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: No Update Planned

UST NCFM: Storage Tank Database
A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 07/17/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: Varies

ROCKLAND COUNTY:

AST - ROCKLAND: Petroleum Bulk Storage Database
A listing of aboveground storage tank sites located in Rockland County. Rockland County?s Petroleum Bulk Storage (PBS) program is no longer in service. All related operations/duties are now wholly overseen by the New York State Dept. of Environmental Conservation (NYSDEC).

Date of Government Version: 02/02/2017
Date Data Arrived at EDR: 03/17/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 189

Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 08/21/2024
Next Scheduled EDR Contact: 12/09/2024
Data Release Frequency: No Update Planned

UST - ROCKLAND: Petroleum Bulk Storage Database
A listing of underground storage tank sites located in Rockland County. Rockland County?s Petroleum Bulk Storage (PBS) program is no longer in service. All related operations/duties are now wholly overseen by the New York State Dept. of Environmental Conservation (NYSDEC).

Date of Government Version: 02/02/2017
Date Data Arrived at EDR: 03/17/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 189

Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 08/21/2024
Next Scheduled EDR Contact: 12/09/2024
Data Release Frequency: No Update Planned

SUFFOLK COUNTY:

AST - SUFFOLK: Storage Tank Database
A listing of aboveground storage tank sites located in Suffolk County.

Date of Government Version: 06/28/2018
Date Data Arrived at EDR: 12/06/2018
Date Made Active in Reports: 02/07/2019
Number of Days to Update: 63

Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 07/17/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: No Update Planned

TANKS SUFFOLK: Storage Tank Database
This county is not included in the state?s database. These are facilities that have no tank information in the storage tank database.

Date of Government Version: 06/28/2018
Date Data Arrived at EDR: 02/05/2019
Date Made Active in Reports: 03/08/2019
Number of Days to Update: 31

Source: Department of Health Services
Telephone: 631-854-2516
Last EDR Contact: 07/17/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: Varies

UST - SUFFOLK: Storage Tank Database
A listing of underground storage tank sites located in Suffolk County.

Date of Government Version: 06/28/2018
Date Data Arrived at EDR: 12/06/2018
Date Made Active in Reports: 02/07/2019
Number of Days to Update: 63

Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 07/17/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: No Update Planned

WESTCHESTER COUNTY:

AST - WESTCHESTER: Listing of Storage Tanks
A listing of aboveground storage tank sites located in Westchester County.

Date of Government Version: 04/15/2024
Date Data Arrived at EDR: 05/15/2024
Date Made Active in Reports: 08/08/2024
Number of Days to Update: 85

Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 07/23/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: Semi-Annually

UST - WESTCHESTER: Listing of Storage Tanks
A listing of underground storage tank sites located in Westchester County.

Date of Government Version: 04/15/2024
Date Data Arrived at EDR: 05/15/2024
Date Made Active in Reports: 08/08/2024
Number of Days to Update: 85

Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 07/23/2024
Next Scheduled EDR Contact: 11/04/2024
Data Release Frequency: Semi-Annually

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data
Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 05/05/2024
Date Data Arrived at EDR: 05/07/2024
Date Made Active in Reports: 08/01/2024
Number of Days to Update: 86

Source: Department of Energy & Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 08/06/2024
Next Scheduled EDR Contact: 11/18/2024
Data Release Frequency: No Update Planned

NJ MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 12/31/2018
Date Data Arrived at EDR: 04/10/2019
Date Made Active in Reports: 05/16/2019
Number of Days to Update: 36

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 06/26/2024
Next Scheduled EDR Contact: 10/14/2024
Data Release Frequency: Annually

PA MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 06/30/2018
Date Data Arrived at EDR: 07/19/2019
Date Made Active in Reports: 09/10/2019
Number of Days to Update: 53

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 07/03/2024
Next Scheduled EDR Contact: 10/21/2024
Data Release Frequency: Annually

RI MANIFEST: Manifest information
Hazardous waste manifest information

Date of Government Version: 12/31/2020
Date Data Arrived at EDR: 11/30/2021
Date Made Active in Reports: 02/18/2022
Number of Days to Update: 80

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 08/08/2024
Next Scheduled EDR Contact: 11/26/2024
Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data
Hazardous waste manifest information.

Date of Government Version: 10/28/2019
Date Data Arrived at EDR: 10/29/2019
Date Made Active in Reports: 01/09/2020
Number of Days to Update: 72

Source: Department of Environmental Conservation
Telephone: 802-241-3443
Last EDR Contact: 07/03/2024
Next Scheduled EDR Contact: 10/21/2024
Data Release Frequency: Annually

WI MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 05/31/2018
Date Data Arrived at EDR: 06/19/2019
Date Made Active in Reports: 09/03/2019
Number of Days to Update: 76

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 06/03/2024
Next Scheduled EDR Contact: 09/16/2024
Data Release Frequency: Annually

Oil/Gas Pipelines
Source: Endeavor Business Media
Petroleum Bundle (Crude Oil, Refined Products, Petrochemicals, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)) N = Natural Gas Bundle (Natural Gas, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)). This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

Electric Power Transmission Line Data
Source: Endeavor Business Media
This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:
Source: American Hospital Association, Inc.
Telephone: 312-280-5991
The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing
Source: Centers for Medicare & Medicaid Services
Telephone: 410-786-3000
A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes
Source: National Institutes of Health
Telephone: 301-594-6248
Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Private Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on private school locations in the United States.
Daycare Centers: Day Care Providers
Source: Department of Health
Telephone: 212-676-2444

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.
Source: FEMA
Telephone: 877-336-2627
Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005, 2010 and 2015 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands
Source: Department of Environmental Conservation
Telephone: 518-402-8961

Current USGS 7.5 Minute Topographic Map
Source: U.S. Geological Survey

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK ®- PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

EAST ADAMS REDEVELOPMENT PHASE THREE AREA
200 CHAVEZ TERRACE
SYRACUSE, NY 13202

TARGET PROPERTY COORDINATES

Latitude (North):	43.040957 - 43° 2' 27.45''
Longitude (West):	76.146874 - 76° 8' 48.75''
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	406579.2
UTM Y (Meters):	4765786.0
Elevation:	398 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	14115660 SYRACUSE WEST, NY
Version Date:	2019
East Map:	14115658 SYRACUSE EAST, NY
Version Date:	2019

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).

TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General West

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

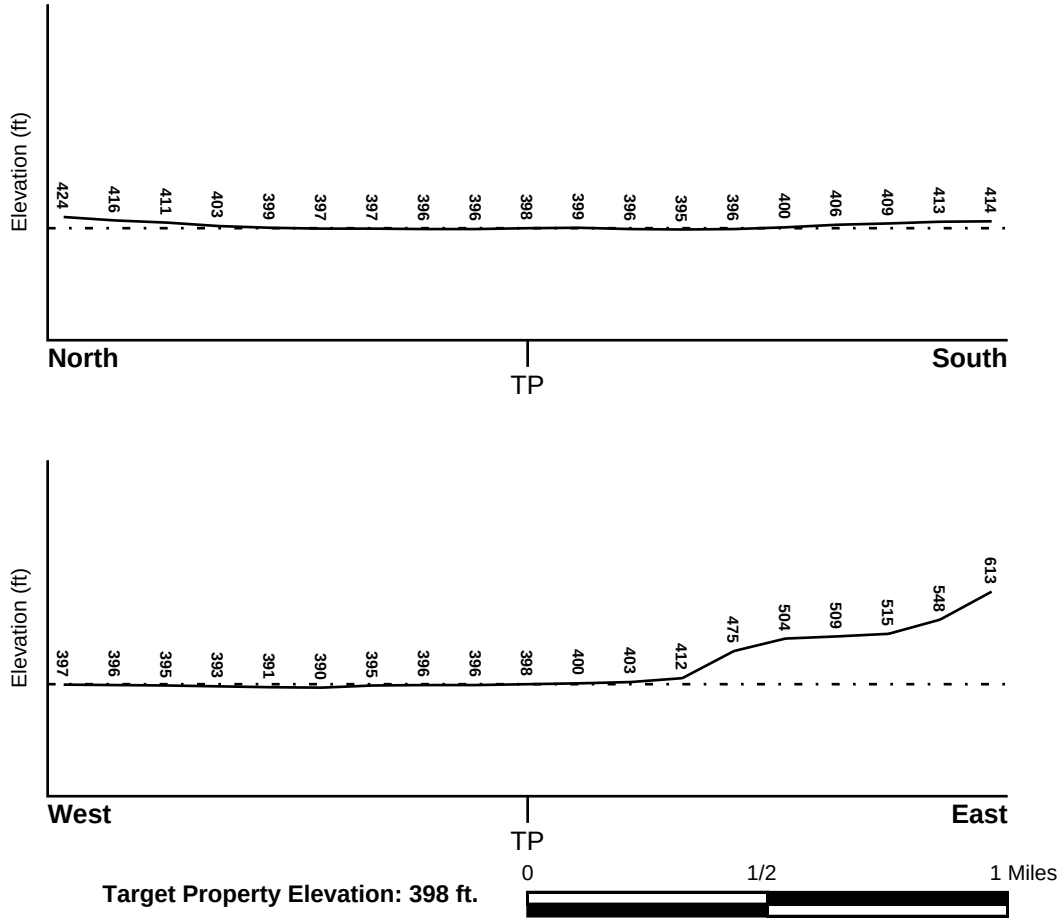

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Flood Plain Panel at Target Property	FEMA Source Type
3605950004E	FEMA Q3 Flood data

Additional Panels in search area:	FEMA Source Type
3605950003E	FEMA Q3 Flood data
3605950015E	FEMA Q3 Flood data

NATIONAL WETLAND INVENTORY

NWI Quad at Target Property	NWI Electronic Data Coverage
SYRACUSE WEST	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius:	1.25 miles
Status:	Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

MAP ID	LOCATION FROM TP	GENERAL DIRECTION GROUNDWATER FLOW
Not Reported		

* ©1996 Site−specific hydrogeological data gathered by CERCLIS Alerts, Inc., Bainbridge Island, WA. All rights reserved. All of the information and opinions presented are those of the cited EPA report(s), which were completed under a Comprehensive Environmental Response Compensation and Liability Information System (CERCLIS) investigation.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

Era:	Paleozoic
System:	Silurian
Series:	Upper Silurian (Cayugan)
Code:	S3 *(decoded above as Era, System & Series)*

GEOLOGIC AGE IDENTIFICATION

Category: Stratifed Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

SSURGO SOIL MAP - 7748282.2s

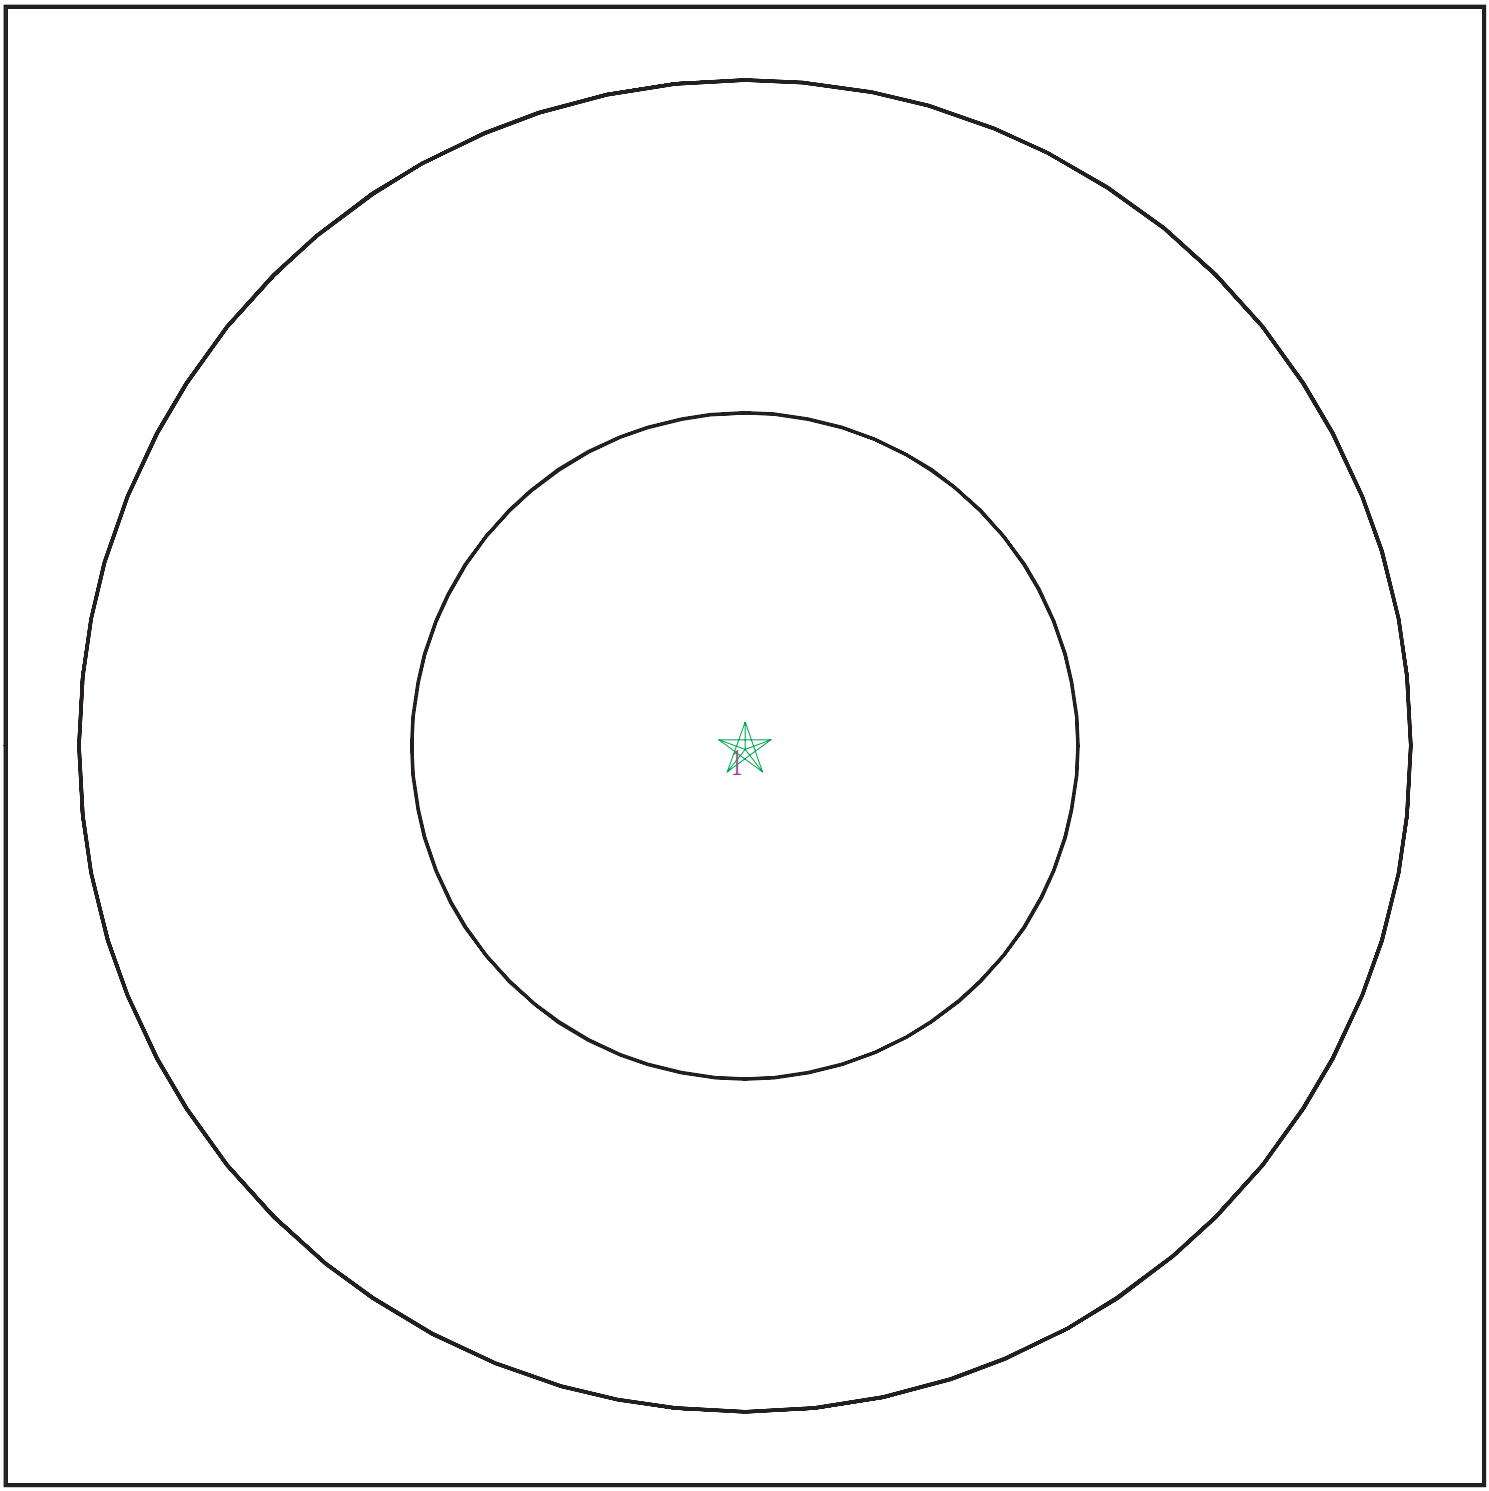

Target Property
SSURGO Soil
Water

0 1/16 1/8 1/4 Miles

N

SITE NAME:	East Adams Redevelopment Phase Three Area	CLIENT:	Langan Engineering, Inc.
ADDRESS:	200 Chavez Terrace Syracuse NY 13202	CONTACT:	Sarah Gardner
LAT/LONG:	43.040957 / 76.146874	INQUIRY #:	7748282.2s
		DATE:	August 28, 2024 12:50 pm

Copyright © 2024 EDR, Inc. © 2015 TomTom Rel. 2015.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1

Soil Component Name: Urban land

Soil Surface Texture:
Hydrologic Group: Not reported

Soil Drainage Class:
Hydric Status: Unknown

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

No Layer Information available.

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

DATABASE	SEARCH DISTANCE (miles)
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
A1	USGS40000869129	1/8 - 1/4 Mile North
A2	USGS40000869128	1/8 - 1/4 Mile NNE
3	USGS40000869054	1/8 - 1/4 Mile West
4	USGS40000868998	1/8 - 1/4 Mile WSW

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
5	USGS40000869167	1/8 - 1/4 Mile North
B6	USGS40000868997	1/8 - 1/4 Mile ESE
C7	USGS40000869139	1/8 - 1/4 Mile NW
D8	USGS40000869182	1/8 - 1/4 Mile NNW
D9	USGS40000869183	1/8 - 1/4 Mile NNW
C10	USGS40000869168	1/8 - 1/4 Mile NW
B11	USGS40000869022	1/8 - 1/4 Mile East
12	USGS40000868922	1/8 - 1/4 Mile SSE
13	USGS40000869138	1/8 - 1/4 Mile NE
C14	USGS40000869169	1/4 - 1/2 Mile NW
15	USGS40000869218	1/4 - 1/2 Mile North
E16	USGS40000869205	1/4 - 1/2 Mile NNW
E17	USGS40000869206	1/4 - 1/2 Mile NW
18	USGS40000869194	1/4 - 1/2 Mile NE
F19	USGS40000869170	1/4 - 1/2 Mile NW
F20	USGS40000869154	1/4 - 1/2 Mile WNW
21	USGS40000869228	1/4 - 1/2 Mile NNE
22	USGS40000869100	1/4 - 1/2 Mile ENE
F23	USGS40000869140	1/4 - 1/2 Mile WNW
E24	USGS40000869246	1/4 - 1/2 Mile NNW
25	USGS40000869260	1/4 - 1/2 Mile NNW
E26	USGS40000869229	1/4 - 1/2 Mile NNW
27	USGS40000869219	1/4 - 1/2 Mile NW
28	USGS40000869166	1/4 - 1/2 Mile ENE
29	USGS40000868887	1/4 - 1/2 Mile SE
G30	USGS40000869120	1/4 - 1/2 Mile WNW
G31	USGS40000869110	1/4 - 1/2 Mile WNW
H32	USGS40000868967	1/4 - 1/2 Mile WSW
I33	USGS40000869066	1/4 - 1/2 Mile East
I34	USGS40000869078	1/4 - 1/2 Mile East
35	USGS40000869010	1/4 - 1/2 Mile East
J36	USGS40000868833	1/4 - 1/2 Mile SSE
J37	USGS40000868806	1/4 - 1/2 Mile SSE
38	USGS40000869165	1/4 - 1/2 Mile ENE
H39	USGS40000868946	1/4 - 1/2 Mile WSW
J40	USGS40000868805	1/4 - 1/2 Mile SSE
K41	USGS40000869337	1/4 - 1/2 Mile NNE
K42	USGS40000869336	1/4 - 1/2 Mile NNE
43	USGS40000869282	1/4 - 1/2 Mile NE
K44	USGS40000869335	1/4 - 1/2 Mile NNE
46	USGS40000868777	1/2 - 1 Mile SSW
L47	USGS40000869204	1/2 - 1 Mile ENE
M48	USGS40000869207	1/2 - 1 Mile WNW
L49	USGS40000869203	1/2 - 1 Mile ENE
50	USGS40000869295	1/2 - 1 Mile NW
N51	USGS40000869370	1/2 - 1 Mile NNE
54	USGS40000869409	1/2 - 1 Mile North
M56	USGS40000869230	1/2 - 1 Mile WNW
P57	USGS40000869410	1/2 - 1 Mile NNW
N58	USGS40000869396	1/2 - 1 Mile NNE
59	USGS40000869208	1/2 - 1 Mile WNW
Q60	USGS40000869310	1/2 - 1 Mile NW

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
P61	USGS40000869423	1/2 - 1 Mile North
62	USGS40000869397	1/2 - 1 Mile NNW
Q63	USGS40000869283	1/2 - 1 Mile NW
R64	USGS40000869270	1/2 - 1 Mile NW
65	USGS40000869321	1/2 - 1 Mile NE
S66	USGS40000868795	1/2 - 1 Mile SE
S67	USGS40000868776	1/2 - 1 Mile SE
68	USGS40000868757	1/2 - 1 Mile SW
R69	USGS40000869311	1/2 - 1 Mile NW
70	USGS40000869460	1/2 - 1 Mile North
71	USGS40000869461	1/2 - 1 Mile NNW
T72	USGS40000869474	1/2 - 1 Mile North
73	USGS40000869209	1/2 - 1 Mile WNW
U74	USGS40000869424	1/2 - 1 Mile NNW
75	USGS40000869452	1/2 - 1 Mile NNE
U76	USGS40000869462	1/2 - 1 Mile NNW
U77	USGS40000869437	1/2 - 1 Mile NNW
78	USGS40000869377	1/2 - 1 Mile NW
79	USGS40000869408	1/2 - 1 Mile NE
T80	USGS40000869550	1/2 - 1 Mile North
V81	USGS40000869501	1/2 - 1 Mile NNW
82	USGS40000868711	1/2 - 1 Mile SSW
V83	USGS40000869502	1/2 - 1 Mile NNW
W84	USGS40000869534	1/2 - 1 Mile North
W85	USGS40000869535	1/2 - 1 Mile North
86	USGS40000869453	1/2 - 1 Mile NW
X87	USGS40000869489	1/2 - 1 Mile NNW
X88	USGS40000869503	1/2 - 1 Mile NNW
Y89	USGS40000869488	1/2 - 1 Mile NNE
90	USGS40000869533	1/2 - 1 Mile NNE
91	USGS40000869565	1/2 - 1 Mile North
W92	USGS40000869549	1/2 - 1 Mile North
93	USGS40000869566	1/2 - 1 Mile North
Y94	USGS40000869517	1/2 - 1 Mile NNE
95	USGS40000868690	1/2 - 1 Mile SW
96	USGS40000869425	1/2 - 1 Mile NW
Z97	USGS40000869518	1/2 - 1 Mile NW
98	USGS40000869516	1/2 - 1 Mile NE
99	USGS40000869475	1/2 - 1 Mile NW
100	USGS40000869411	1/2 - 1 Mile NW
Z101	USGS40000869519	1/2 - 1 Mile NW
AA102	USGS40000869624	1/2 - 1 Mile NNW
AA103	USGS40000869654	1/2 - 1 Mile NNW
104	USGS40000869601	1/2 - 1 Mile NNW
105	USGS40000869646	1/2 - 1 Mile NNW
106	USGS40000869592	1/2 - 1 Mile NW

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	LOCATION FROM TP

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
45	NY0002476	1/4 - 1/2 Mile North

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
O52	NYWS50000072550	1/2 - 1 Mile NNW
O53	NYWS50000072549	1/2 - 1 Mile NNW
O55	NYWS50000072462	1/2 - 1 Mile NNW

PHYSICAL SETTING SOURCE MAP - 7748282.2s

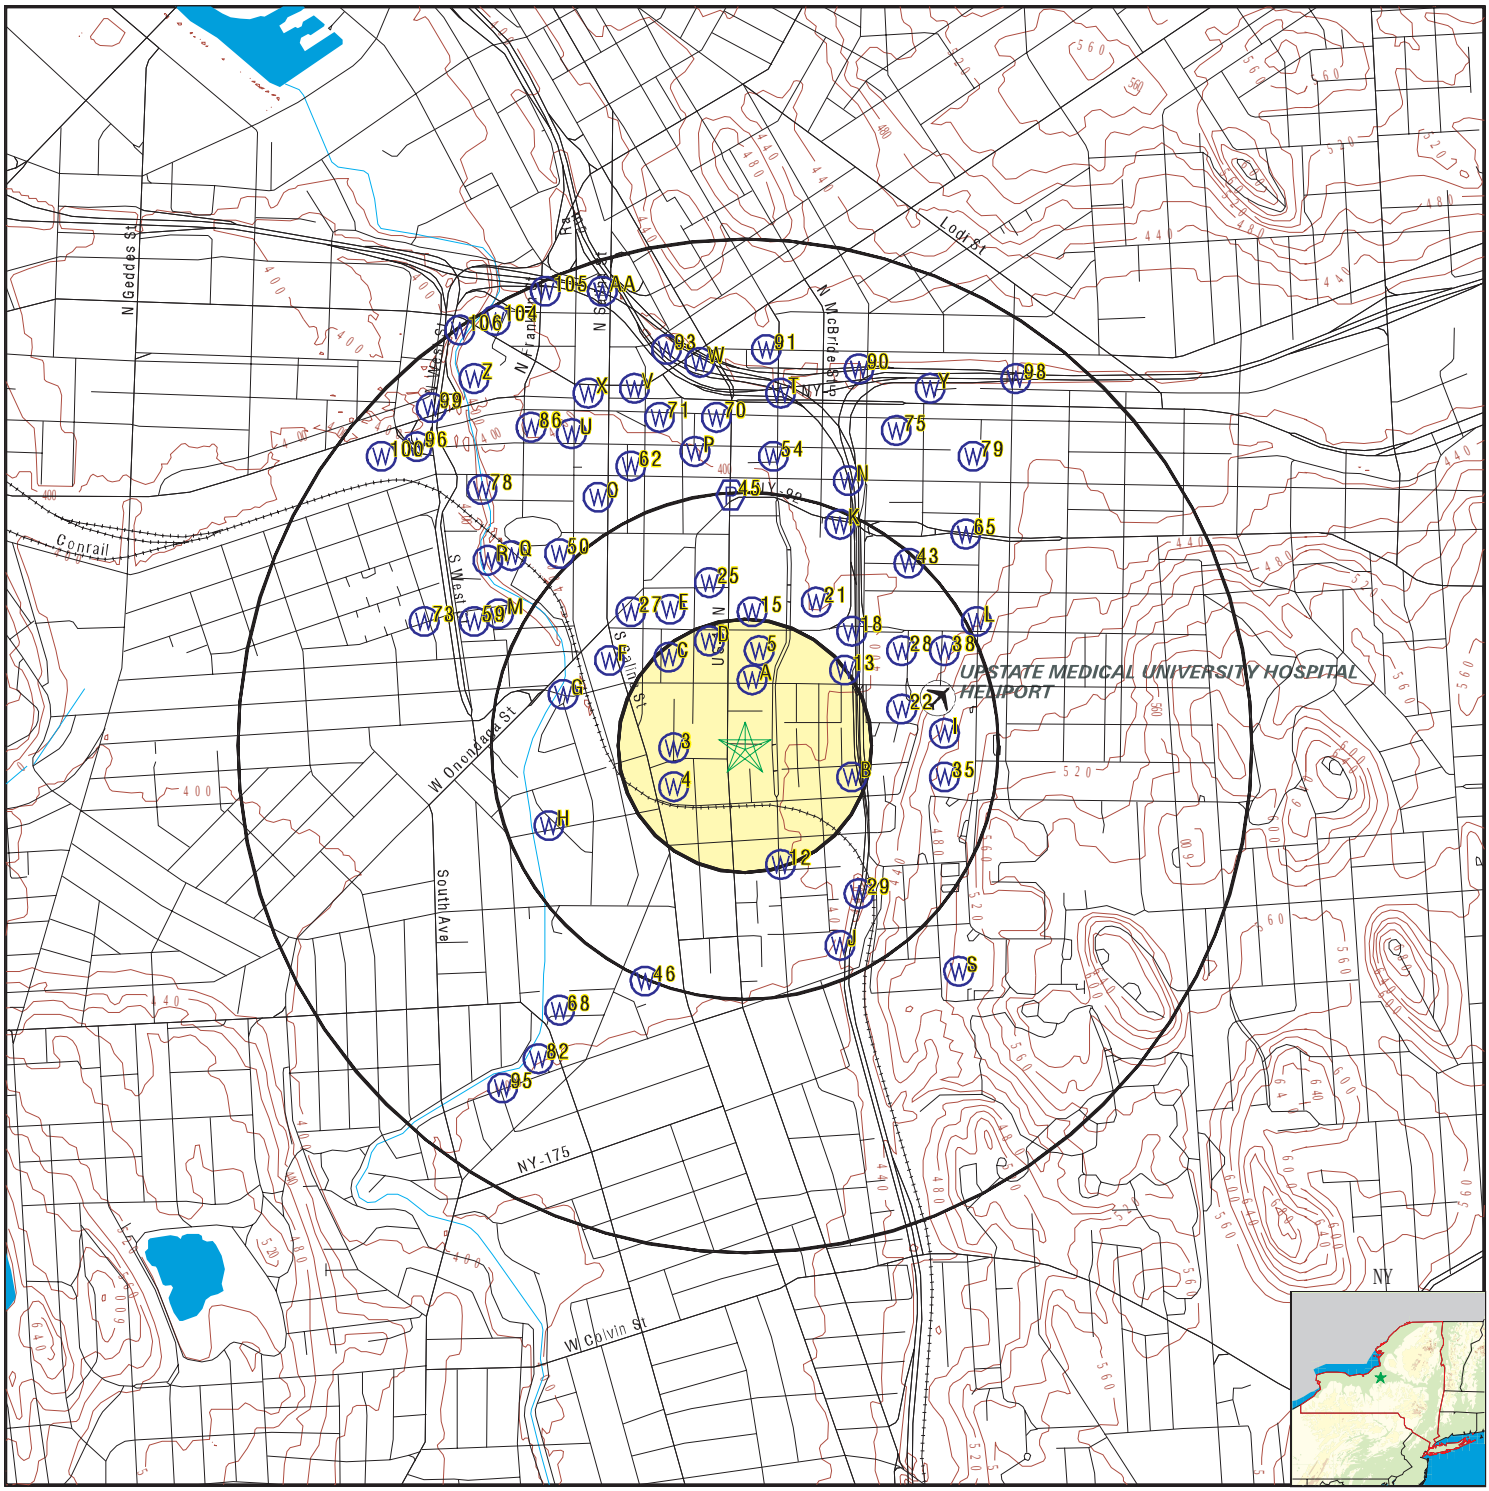

- County Boundary
- Major Roads
- Contour Lines
- Airports
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons
- Groundwater Flow Direction
- Indeterminate Groundwater Flow at Location
- Groundwater Flow Varies at Location
- Closest Hydrogeological Data
- Oil, gas or related wells

SITE NAME:	East Adams Redevelopment Phase Three Area	CLIENT:	Langan Engineering, Inc.
ADDRESS:	200 Chavez Terrace Syracuse NY 13202	CONTACT:	Sarah Gardner
LAT/LONG:	43.040957 / 76.146874	INQUIRY #:	7748282.2s
		DATE:	August 28, 2024 12:49 pm

Copyright © 2024 EDR, Inc. © 2015 TomTom Rel. 2015.

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

A1
North
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000869129**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 581		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	101	Well Hole Depth Units:	ft

A2
NNE
1/8 - 1/4 Mile
Higher

FED USGS **USGS40000869128**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 580		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	113	Well Hole Depth Units:	ft

3
West
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000869054**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1067		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19860207
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	151	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1986-02-07
Feet below surface:	8.7	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

4
WSW **FED USGS** **USGS40000868998**
1/8 - 1/4 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1689		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610824
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	166.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-08-24
Feet below surface:	9.5	Feet to sea level:	Not Reported
Note:	Not Reported		

5
North **FED USGS** **USGS40000869167**
1/8 - 1/4 Mile
Lower

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 579		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	115	Well Hole Depth Units:	ft

B6
ESE **FED USGS** **USGS40000868997**
1/8 - 1/4 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1687		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19630709
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	69	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1963-07-09
Feet below surface:	14.7	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

C7
NW
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000869139**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 578		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	122	Well Hole Depth Units:	ft

D8
NNW
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000869182**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1068		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19700729
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	109.6	Well Hole Depth Units:	ft

D9
NNW
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000869183**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 582		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	119	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

C10
NW
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000869168**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 577		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	102	Well Hole Depth Units:	ft

B11
East
1/8 - 1/4 Mile
Higher

FED USGS **USGS40000869022**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 553		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	75	Well Hole Depth Units:	ft

12
SSE
1/8 - 1/4 Mile
Higher

FED USGS **USGS40000868922**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1686		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	195912
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	155	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

13
NE
1/8 - 1/4 Mile
Higher

FED USGS **USGS40000869138**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 554		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	63	Well Hole Depth Units:	ft

C14
NW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869169**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1501		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19640228
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	140	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1964-02-28
Feet below surface:	20	Feet to sea level:	Not Reported
Note:	Not Reported		

15
North
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869218**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1678		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196301
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	101	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1963-01
Feet below surface:	27	Feet to sea level:	Not Reported
Note:	Not Reported		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

E16
NNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869205**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1099		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19640217
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	140	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1964-02-17
Feet below surface:	19.0	Feet to sea level:	Not Reported
Note:	Not Reported		

E17
NW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869206**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1679		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140202
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19700114
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	68.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1970-01-14
Feet below surface:	27	Feet to sea level:	Not Reported
Note:	Not Reported		

18
NE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869194**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 552		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	81	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

F19
NW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869170**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 248	Type:	Well
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	Not Reported	Well Depth:	56
Well Depth Units:	ft	Well Hole Depth:	Not Reported
Well Hole Depth Units:	Not Reported		

F20
WNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869154**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 246	Type:	Well
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	65	Well Depth Units:	ft
Well Hole Depth:	Not Reported	Well Hole Depth Units:	Not Reported

---

21
NNE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869228**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1675		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19720309
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	112.7	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1972-03-09
Feet below surface:	15	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

22
ENE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869100**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1699		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196809
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	20	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1968-09
Feet below surface:	11.3	Feet to sea level:	Not Reported
Note:	Not Reported		

F23
WNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869140**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 245	Type:	Well
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	Not Reported	Well Depth:	36
Well Depth Units:	ft	Well Hole Depth:	Not Reported
Well Hole Depth Units:	Not Reported		

E24
NNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869246**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1500		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19640206
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	140	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1964-02-06
Feet below surface:	5	Feet to sea level:	Not Reported
Note:	Not Reported		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

25
NNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869260**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1677		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19720418
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	114	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1972-04-18
Feet below surface:	43.7	Feet to sea level:	Not Reported
Note:	Not Reported		

E26
NNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869229**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1098		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19640210
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	160	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1964-02-10
Feet below surface:	16.0	Feet to sea level:	Not Reported
Note:	Not Reported		

27
NW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869219**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 13	Type:	Well
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	Not Reported	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	Not Reported
Well Hole Depth Units:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

28
ENE **FED USGS** **USGS40000869166**
1/4 - 1/2 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1693		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	197306
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	68	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1973-06
Feet below surface:	10	Feet to sea level:	Not Reported
Note:	Not Reported		

29
SE **FED USGS** **USGS40000868887**
1/4 - 1/2 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 550		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	30	Well Hole Depth Units:	ft

G30
WNW **FED USGS** **USGS40000869120**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1716		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19580721
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	91	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1958-07-21
Feet below surface:	25	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

G31
WNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869110**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 549		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	91	Well Hole Depth Units:	ft

H32
WSW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000868967**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1073		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19790316
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	72	Well Hole Depth Units:	ft

I33
East
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869066**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1698		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196708
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	58	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

I34
East
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869078**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 518		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	49	Well Hole Depth Units:	ft

35
East
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869010**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1700		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	197010
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	61	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1970-10
Feet below surface:	5	Feet to sea level:	Not Reported
Note:	Not Reported		

J36
SSE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000868833**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 548		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	65	Well Hole Depth Units:	ft

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

J37
SSE **FED USGS** **USGS40000868806**
1/4 - 1/2 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1772		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	20000522
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	67	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	2000-05-22
Feet below surface:	7.6	Feet to sea level:	Not Reported
Note:	Not Reported		

38
ENE **FED USGS** **USGS40000869165**
1/4 - 1/2 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1697		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196708
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	51.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1967-08
Feet below surface:	8.5	Feet to sea level:	Not Reported
Note:	Not Reported		

H39
WSW **FED USGS** **USGS40000868946**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1502		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19900308
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	70	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-03-08
Feet below surface:	13.9	Feet to sea level:	Not Reported
Note:	Not Reported		

J40
SSE **FED USGS** **USGS40000868805**
1/4 - 1/2 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1517		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610327
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	55	Well Hole Depth Units:	ft

K41
NNE **FED USGS** **USGS40000869337**
1/4 - 1/2 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1513		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610603
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	110	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-06-03
Feet below surface:	21.4	Feet to sea level:	Not Reported
Note:	Not Reported		

K42
NNE **FED USGS** **USGS40000869336**
1/4 - 1/2 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 551		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	102	Well Hole Depth Units:	ft

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

43
NE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869282**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1696		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196910
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	80	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1969-10
Feet below surface:	16.7	Feet to sea level:	Not Reported
Note:	Not Reported		

K44
NNE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869335**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1523		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610407
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	127.3	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-04-07
Feet below surface:	28	Feet to sea level:	Not Reported
Note:	Not Reported		

45
North
1/4 - 1/2 Mile
Higher

FRDS PWS **NY0002476**

PWS ID:	NY0002476	PWS type:	System Owner/Responsible Party
PWS name:	ROSHAK OREST	PWS address:	UNION SPRINGS ACADEMY
PWS address:	SPRING STREET, BOX 43-A	PWS city:	UNION SPRINGS
PWS state:	NY	PWS zip:	13160
PWS ID:	NY0002476	PWS type:	System Owner/Responsible Party
PWS name:	ROSHAK OREST	PWS address:	UNION SPRINGS ACADEMY
PWS address:	SPRING STREET, BOX 43-A	PWS city:	UNION SPRINGS
PWS state:	NY	PWS zip:	13160
PWS ID:	NY0002476	Activity status:	Active
Date system activated:	Not Reported	Date system deactivated:	Not Reported
Retail population:	00000165	System name:	UNION SPRINGS ACADEMY

System address:	Not Reported	System address:	SPRING STREET
System city:	UNION SPRINGS	System state:	NY
System zip:	13160		
County FIPS:	005	City served:	SPRINGPORT (T)
Latitude:	430253	Longitude:	0760852

46
SSW
1/2 - 1 Mile
Lower

FED USGS **USGS40000868777**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1685		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19631015
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	87.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1963-10-15
Feet below surface:	14	Feet to sea level:	Not Reported
Note:	Not Reported		

L47
ENE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869204**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1633		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	1977
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	42.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1977
Feet below surface:	21.1	Feet to sea level:	Not Reported
Note:	Not Reported		

M48
WNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869207**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1868		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201

Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	20020920	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	70
Well Hole Depth Units:	ft		

L49
ENE **FED USGS** **USGS40000869203**
1/2 - 1 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1695		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196910
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	42	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1969-10
Feet below surface:	19	Feet to sea level:	Not Reported
Note:	Not Reported		

50
NW **FED USGS** **USGS40000869295**
1/2 - 1 Mile
Lower

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1690		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19710922
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	101.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1971-09-22
Feet below surface:	29	Feet to sea level:	Not Reported
Note:	Not Reported		

N51
NNE **FED USGS** **USGS40000869370**
1/2 - 1 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1522		
Type:	Well: Test hole not completed as a well		

Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610417
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	76	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-04-17
Feet below surface:	16	Feet to sea level:	Not Reported
Note:	Not Reported		

O52
NNW
1/2 - 1 Mile
Lower

NY WELLS **NYWS50000072550**

WELLS:

DEC Well #:	OD02380	Well Depth (ft):	80
Bedrock Depth (ft):	-999	Groundwater Depth (ft):	30
Casing Depth (ft):	71	Casing 1 Diameter (in):	8
Casing 1 Length (ft):	64	Casing 2 Diameter (in):	Not Reported
Casing 2 Length (ft):	Not Reported	Screened Well:	Y
Screen Length (ft):	Not Reported	Avg Discharge Rate (gpm):	200
Well Purpose:	Not Reported	Driller Registration #:	NYRD10142
Report Date:	12-DEC-13	Drilling Start Date:	23-MAY-13
Drilling Completion Date:	24-MAY-13		

O53
NNW
1/2 - 1 Mile
Lower

NY WELLS **NYWS50000072549**

WELLS:

DEC Well #:	OD02379	Well Depth (ft):	76
Bedrock Depth (ft):	77	Groundwater Depth (ft):	30
Casing Depth (ft):	67	Casing 1 Diameter (in):	8
Casing 1 Length (ft):	60	Casing 2 Diameter (in):	Not Reported
Casing 2 Length (ft):	Not Reported	Screened Well:	Y
Screen Length (ft):	Not Reported	Avg Discharge Rate (gpm):	200
Well Purpose:	Not Reported	Driller Registration #:	NYRD10142
Report Date:	12-DEC-13	Drilling Start Date:	21-MAY-13
Drilling Completion Date:	22-MAY-13		

54
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869409**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1681		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported

Aquifer Type:	Not Reported	Construction Date:	19570716
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	32	Well Hole Depth Units:	ft

O55
NNW
1/2 - 1 Mile
Lower

NY WELLS **NYWS50000072462**

WELLS:

DEC Well #:	OD02290	Well Depth (ft):	100
Bedrock Depth (ft):	95	Groundwater Depth (ft):	20
Casing Depth (ft):	84	Casing 1 Diameter (in):	6
Casing 1 Length (ft):	84	Casing 2 Diameter (in):	Not Reported
Casing 2 Length (ft):	Not Reported	Screened Well:	Y
Screen Length (ft):	Not Reported	Avg Discharge Rate (gpm):	100
Well Purpose:	Not Reported	Driller Registration #:	NYRD10142
Report Date:	11-APR-12	Drilling Start Date:	03-APR-12
Drilling Completion Date:	03-APR-12		

M56
WNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869230**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1867		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	20020923	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	69
Well Hole Depth Units:	ft		

P57
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869410**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1682		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19710709
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	48	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1971-07-09
Feet below surface:	12.5	Feet to sea level:	Not Reported

Note: Not Reported

N58
NNE **FED USGS** **USGS40000869396**
1/2 - 1 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 555		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	74	Well Hole Depth Units:	ft

59
WNW **FED USGS** **USGS40000869208**
1/2 - 1 Mile
Lower

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1777		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19950223
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	80	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1995-02-23
Feet below surface:	8	Feet to sea level:	Not Reported
Note:	Not Reported		

Q60
NW **FED USGS** **USGS40000869310**
1/2 - 1 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1866		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	20051101	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	70
Well Hole Depth Units:	ft		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

P61
North
1/2 - 1 Mile
Higher | **FED USGS** | **USGS40000869423**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 571		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	40	Well Hole Depth Units:	ft

62
NNW
1/2 - 1 Mile
Lower | **FED USGS** | **USGS40000869397**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1692		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196812
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	40	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1968-12
Feet below surface:	22	Feet to sea level:	Not Reported
Note:	Not Reported		

Q63
NW
1/2 - 1 Mile
Lower | **FED USGS** | **USGS40000869283**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1854	Type:	Well
Description:	Not Reported	HUC:	Not Reported
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Unconfined single aquifer	Construction Date:	Not Reported
Well Depth:	101	Well Depth Units:	ft
Well Hole Depth:	101	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

R64
NW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869270**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1865		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	20051118	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	101
Well Hole Depth Units:	ft		

65
NE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869321**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1694		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196910
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	56	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1969-10
Feet below surface:	13.8	Feet to sea level:	Not Reported
Note:	Not Reported		

S66
SE
1/2 - 1 Mile
Higher

FED USGS **USGS40000868795**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1753		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	1962
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	129.5	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

S67
SE
1/2 - 1 Mile
Higher

FED USGS **USGS40000868776**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1754		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	1962
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	62	Well Hole Depth Units:	ft

68
SW
1/2 - 1 Mile
Lower

FED USGS **USGS40000868757**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1072		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19980811
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	77	Well Hole Depth Units:	ft

R69
NW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869311**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1864		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	20051122	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	71
Well Hole Depth Units:	ft		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

70
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869460**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 572		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	39	Well Hole Depth Units:	ft

71
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869461**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1680		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	26	Well Hole Depth Units:	ft

T72
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869474**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1516		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610412
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	58	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-04-12
Feet below surface:	21	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

73
WNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869209**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 250	Type:	Well
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	Not Reported	Well Depth:	132
Well Depth Units:	ft	Well Hole Depth:	Not Reported
Well Hole Depth Units:	Not Reported		

U74
NNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869424**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1767		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19890910
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	47	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1989-09-10
Feet below surface:	22	Feet to sea level:	Not Reported
Note:	Not Reported		

75
NNE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869452**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1853	Type:	Well
Description:	Not Reported	HUC:	Not Reported
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	New York and New England carbonate-rock aquifers		
Formation Type:	Vernon Shale	Aquifer Type:	Confined multiple aquifer
Construction Date:	20060215	Well Depth:	410
Well Depth Units:	ft	Well Hole Depth:	410
Well Hole Depth Units:	ft		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

U76
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869462**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1529		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19700713
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	58	Well Hole Depth Units:	ft

U77
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869437**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 574		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	101	Well Hole Depth Units:	ft

78
NW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869377**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1869		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	20000914	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	75
Well Hole Depth Units:	ft		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

79
NE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869408**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1688		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140202
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19690529
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	60	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1969-05-29
Feet below surface:	12.7	Feet to sea level:	Not Reported
Note:	Not Reported		

T80
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869550**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 520		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	52	Well Hole Depth Units:	ft

V81
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869501**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1779		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19900403
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	29.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-04-03
Feet below surface:	12	Feet to sea level:	Not Reported
Note:	Not Reported		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

82
SSW
1/2 - 1 Mile
Lower

FED USGS **USGS40000868711**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1070		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	20010326
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	61	Well Hole Depth Units:	ft

V83
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869502**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 558		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	55	Well Hole Depth Units:	ft

W84
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869534**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 563		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	40	Well Hole Depth Units:	ft

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

W85
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869535**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1525		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19600420
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	42	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1960-04-20
Feet below surface:	21	Feet to sea level:	Not Reported
Note:	Not Reported		

86
NW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869453**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 573		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	100	Well Hole Depth Units:	ft

X87
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869489**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 556		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	65	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

X88
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869503**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 557		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	55	Well Hole Depth Units:	ft

Y89
NNE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869488**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1518		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610510
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	72	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-05-10
Feet below surface:	32	Feet to sea level:	Not Reported
Note:	Not Reported		

90
NNE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869533**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 565		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	60	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

91
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869565**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1631		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	1977
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	23	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1977
Feet below surface:	15.5	Feet to sea level:	Not Reported
Note:	Not Reported		

W92
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869549**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 522		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	36	Well Hole Depth Units:	ft

93
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869566**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1515		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610424
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	35	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-04-24
Feet below surface:	12	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

Y94
NNE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869517**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1603		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19620702
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	70	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1962-07-02
Feet below surface:	31	Feet to sea level:	Not Reported
Note:	Not Reported		

95
SW
1/2 - 1 Mile
Higher

FED USGS **USGS40000868690**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1071		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	20010322
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	61	Well Hole Depth Units:	ft

96
NW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869425**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1701		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19770426
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	136.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1977-04-26
Feet below surface:	34.5	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

Z97
NW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869518**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 592		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	64	Well Hole Depth Units:	ft

98
NE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869516**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1604		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19620628
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	64	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1962-06-28
Feet below surface:	31	Feet to sea level:	Not Reported
Note:	Not Reported		

99
NW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869475**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1717		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19600429
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	100	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1960-04-29
Feet below surface:	22	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

100
NW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869411**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1702		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19770427
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	101.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1977-04-27
Feet below surface:	18	Feet to sea level:	Not Reported
Note:	Not Reported		

Z101
NW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869519**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1718		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19600411
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	101.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1960-04-11
Feet below surface:	45	Feet to sea level:	Not Reported
Note:	Not Reported		

AA102
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869624**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 564		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	50	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AA103
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869654**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 519		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	55	Well Hole Depth Units:	ft

104
NNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869601**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1530		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610517
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	41	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-05-17
Feet below surface:	3	Feet to sea level:	Not Reported
Note:	Not Reported		

105
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869646**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1514		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610427
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	34.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-04-27
Feet below surface:	14.0	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

	Database	EDR ID Number
106 **NW** **1/2 - 1 Mile** **Lower**	**FED USGS**	**USGS40000869592**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1760		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19970620
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	170	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS
RADON

AREA RADON INFORMATION

State Database: NY Radon

Radon Test Results

County	Town	Num Tests	Avg Result	Geo Mean	Max Result
ONONDAGA	CAMILLUS	980	11.38	6	188.3
ONONDAGA	CICERO	275	1.96	1.28	30.5
ONONDAGA	CLAY	328	2	1.19	30.4
ONONDAGA	DE WITT	754	10.01	3.76	346.7
ONONDAGA	ELBRIDGE	129	13.42	6.2	96.1
ONONDAGA	FABIUS	26	5.17	3.03	26.5
ONONDAGA	GEDDES	291	9.25	4.79	99.3
ONONDAGA	LAFAYETTE	105	7.39	4.25	95.6
ONONDAGA	LYSANDER	272	4.14	2.1	89.1
ONONDAGA	MANLIUS	1,442	11.4	5.03	341.8
ONONDAGA	MARCELLUS	251	5.91	3.39	98
ONONDAGA	ONONDAGA	294	10.8	5.9	89.4
ONONDAGA	OTISCO	21	7.32	3.64	40.1
ONONDAGA	POMPEY	105	6.84	4.7	35
ONONDAGA	SALINA	449	2.49	1.49	69.5
ONONDAGA	SKANEATELES	203	4.39	2.43	105.7
ONONDAGA	SPAFFORD	16	3.66	2.32	8.8
ONONDAGA	SYRACUSE	2,334	6.8	3.48	185.4
ONONDAGA	TULLY	140	18.29	8.48	165.2
ONONDAGA	VAN BUREN	119	6.68	2.5	70.1

Federal EPA Radon Zone for ONONDAGA County: 1

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for ONONDAGA COUNTY, NY

Number of sites tested: 476

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area	1.760 pCi/L	76%	21%	3%
Basement	3.000 pCi/L	62%	29%	9%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)
Source: United States Geologic Survey
EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Current USGS 7.5 Minute Topographic Map
Source: U.S. Geological Survey

HYDROLOGIC INFORMATION

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.
Source: FEMA
Telephone: 877-336-2627
Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005, 2010 and 2015 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands
Source: Department of Environmental Conservation
Telephone: 518-402-8961

HYDROGEOLOGIC INFORMATION

AQUIFLOW^{R} Information System
Source: EDR proprietary database of groundwater flow information
EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit
Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)
The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)
Telephone: 800-672-5559
SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Service, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)
This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

New York Public Water Wells
Source: New York Department of Health
Telephone: 518-458-6731

OTHER STATE DATABASE INFORMATION

Oil and Gas Well Database
Source: Department of Environmental Conservation
Telephone: 518-402-8072
These files contain records, in the database, of wells that have been drilled.

RADON

State Database: NY Radon
Source: Department of Health
Telephone: 518-402-7556
Radon Test Results

Area Radon Information
Source: USGS
Telephone: 703-356-4020
The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones
Source: EPA
Telephone: 703-356-4020
Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities
Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater
Source: Department of Commerce, National Oceanic and Atmospheric Administration

Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary faultlines, prepared in 1975 by the United State Geological Survey

PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

Appendix G Resumes of Environmental Professionals

BRIAN GOCHENAUR, QEP

ASSOCIATE PRINCIPAL

ENVIRONMENTAL SCIENTIST

Mr. Gochenaur is an environmental project manager with 20 years of experience in environmental due diligence, site investigation and remediation, fuel oil storage tank investigation and removal, soil vapor intrusion assessments, in-situ remedial technology, spill closure, vapor barrier and sub-slab depressurization system design and construction, emergency response, environmental and geotechnical site investigations, and health and safety monitoring. He has extensive experience with the New York State Department of Environmental Conservation (NYSDEC) Brownfield Cleanup, Voluntary Cleanup and Spill Programs and New York City Department of Environmental Protection (NYCDEP) "E" Designated and New York City Voluntary Cleanup Program (BCP) sites. His areas of expertise include Phase I Environmental Site Assessments, Phase II Site Investigations, and environmental consulting and oversight on large scale construction projects.

EDUCATION

B.S., Environmental Science
University of Florida

PROFESSIONAL REGISTRATION

Qualified Environmental Professional (QEP) certified by the Institute of Professional Environmental Practice

40-Hour OSHA (HAZWOPER)

SELECTED PROJECTS

- 440 Washington Street, E-Designated services, New York, NY
- 3514 Surf Avenue, Tall Residential and Retail Building, Brooklyn, NY
- ARO 242 West 53, Tall Residential Building, New York, NY
- NY Aquarium Shark Exhibit, Soil Characterization and Excavation Oversight, Coney Island Neighborhood, Brooklyn, NY
- 60 West Street, Site Investigation and Redevelopment, Brooklyn, NY
- 535 4th Avenue, BCP Auto Repair Cleanup and Redevelopment, Brooklyn, NY
- 1525 Bedford Avenue, BCP Gas Station Cleanup and Redevelopment, Brooklyn, NY
- 220 Eleventh Avenue, Residential Building, New York, NY
- 432 Rodney Street, Residential Building, Brooklyn, NY
- 563 Sackett Street, Brooklyn, NY
- 362 West 125th Street, Residential Building, New York, NY
- Bedford Armory Redevelopment, Brooklyn, NY
- 268 West Street, BCP Redevelopment of Former Commercial and Industrial Site, New York, NY
- 110 125th Street, Soil Excavation and Remediation, New York, NY
- Former Roseland Ballroom Redevelopment, Soil Characterization and Excavation Oversight, New York, NY
- 42 Crosby Street, "E" Designated Site Investigation and Remediation, New York, NY
- New York School Construction Authority, Various Locations, In-House Environmental Consulting, Five Boroughs of New York City
- EZ Serve Portfolio, GE Capital, Various Phase II Site Investigations, FL, GA, LA, and MS
- Beth Elohim Child Daycare Center, Lead Based Paint Abatement, Brooklyn, NY
- Price Battery, Environmental Protection Agency (EPA) Lead Fallout Superfund Site, Hamburg, PA

- Clark Portfolio, GE Capital, Various Phase II Locations, MI, IL, ID, and OH
- Tops Plaza Portfolio, Prudential Real Estate Investors, Various Phase II Locations, NY
- Cingular Wireless Portfolio, Cingular Wireless, Various Locations Phase I and II Locations, WA
- Queens Center Mall Expansion, Remedial Oversight, Elmhurst, NY
- Soka Gakkai International-USA, Cultural Center, Brooklyn, NY
- 1752 Shore Parkway, Environmental Remediation, Brooklyn, NY
- Bedford Union Armory, NYS Brownfield Cleanup Program, Brooklyn, NY
- NYCEDC Manhattan Greenway – Harlem River, New York, NY
- 445 Gerard Avenue, Residential Building, Bronx, NY
- Towne Gardens North, Residential Building, Buffalo, NY

KIMBERLY SEMON, PE

SENIOR PROJECT MANAGER

ENVIRONMENTAL ENGINEERING

Ms. Semon has almost 15 years of experience in the environmental remediation and water resource management fields. Her expertise includes groundwater hydrology, water resource planning and management, environmental remediation design, implementation and management of brownfield sites, and drinking water treatment system design. She has performed environmental field work, site research, data management and report preparation and is currently involved with the senior management of environmental-driven and multi-discipline projects within New York State and beyond. Ms. Semon is also well versed in city, state and federal regulatory programs including the Voluntary Cleanup Program, Brownfield Cleanup Program, and Superfund.

SELECTED PROJECTS

- East Adams Redevelopment Phase Two Area (Phase I ESA, BCP Application, RI, RIR, RAWP), Syracuse, NY
- East Adams Redevelopment AOT & Phase One Area (Phase I ESA, BCP Application), Syracuse, NY
- Town of North Castle Water District 2 (PFAS Drinking Water Treatment System), Armonk, NY
- Nike Fire Training Base (PFAS Evaluation, Investigation), Harrison, NY
- 600 Grumman Road, (Phase I ESA, Pre-Construction Services), Bethpage, NY
- 95-119 Woodworth Avenue (Subsurface Investigation, BCP Application), Yonkers, NY
- 50 Commercial Street, (NYS BCP, In-Situ Groundwater Treatment, Environmental Remediation), Brooklyn, NY
- 326-350 Rockaway Avenue (Phase I ESA, NYS BCP, Environmental Remediation, Closeout), Brooklyn, NY
- 15 East 88th Street (Spill Remediation), New York, NY
- 475 Bay Street & 31 Wave Street (Phase I ESA, Phase II ESI, NYS BCP, Environmental Remediation, AQ/N RAP/IR), Staten Island, NY
- 83 Apollo Street (SMDS Design, Environmental Remediation, SMP), Brooklyn, NY
- 62 Hanson Place (SSDS Retrofit Design), Brooklyn, NY
- 197-201 Canal Street (Phase I ESA, NYS BCP, Environmental Remediation), Staten Island, NY
- 1601 Surf Avenue (NYS BCP, Environmental Remediation), Brooklyn, NY
- 445 Gerard Avenue (NYS BCP, Environmental Remediation, SMP), Bronx, NY
- 414-444 Gerard Avenue, (NYS BCP, Environmental Remediation, Closeout), Bronx, NY
- Novak Farm, (Emerging Contaminant Sampling Work Plan) McDonough, NY

EDUCATION

M.S., Sustainable Engineering – Environmental Sustainability
Villanova University

B.S., Chemical Engineering
Villanova University

PROFESSIONAL REGISTRATION

Professional Engineer (PE) in NY

10-Hour OSHA

40-Hour OSHA (HAZWOPER)

AFFILIATIONS

Society of Women Engineers

American Institute of Chemical Engineers

National Groundwater Association

- 27-01 Jackson Avenue, (Phase I ESA, NYS BCP, In-Situ groundwater Treatment, Environmental Remediation, Groundwater Monitoring), Long Island City, NY
- 26-32 Jackson Avenue, (Phase I ESA, Phase II ESI, NYS BCP, Environmental Remediation), Long Island City, NY
- 266-270 West 96th Street, (Phase I ESA, Phase II ESI, NYS BCP, Environmental Remediation), New York, NY
- 1525 Bedford Avenue, (Noise IR, Quarterly Monitoring Report), Brooklyn, NY
- 805-825 Atlantic Avenue, (Phase I ESAs, Subsurface Investigations, NYS BCP, Environmental Remediation, SMP/OM&M), Brooklyn, NY
- NYU 181 Mercer Street, (NYCOER VCP, RIR, RAWP, Environmental Remediation, Spill Closure), New York, NY
- Tottenham Hale, (Phase II ESI), London, UK
- Nine Elms Square Development (Phase II Reporting), London, UK
- Queens Plaza North, (NYS BCP, Environmental Remediation, Closeout), Long Island City, NY
- 335 Bond Street, (BCP Application, Subsurface Investigations, Groundwater Remediation Design), Brooklyn, NY
- 540 West 21st Street, (NYC Voluntary Cleanup Program, RIR, RAWP), New York, NY
- 982-998 Fulton Street, (Phase I ESA), Brooklyn, NY
- 121 Christopher Street, (Phase I ESA), New York, NY
- 2415-2419 Jerome Avenue (Phase I ESA, Phase II ESI, Spill Closure), Bronx, NY
- 267 West 87th Street, (Remedial Investigation & Report), New York, NY
- 211-215 East 38th Street, (Phase I ESA, Phase II ESI), New York, NY
- 615 Tenth Avenue, (Reporting), New York, NY
- River Place I & II, (Annual Reporting, Groundwater Monitoring), New York, NY
- Riverside Parcel 5, (Construction Oversight, Endpoint Sampling, Closure Report), New York, NY
- Riverside Parcel 2, (Construction Oversight), New York, NY
- 170 Amsterdam Avenue, (Construction Oversight), New York, NY
- 17-29 West End Avenue, (Construction Oversight), New York, NY
- 539 Smith Street Bulkhead, , (Construction Oversight), Brooklyn, NY
- Brooklyn Academy of Music North Tower, (Construction Oversight, FER), New York, NY
- Brooklyn Solvent Site (Whitehead Realty), (Construction Oversight), Brooklyn, NY
- Hudson Yards, Terra Firma, (Construction Oversight), New York, NY
- 616 First Avenue, (Construction Oversight), New York, NY
- 27 Wooster Street, (Closure Report), New York, NY
- Columbia University Manhattanville Development, Phase IA & Topdown Area, (Closure Report), New York, NY

SARAH GARDNER, EIT

SENIOR STAFF ENGINEER

ENVIRONMENTAL ENGINEERING

Ms. Gardner graduated from the University of Illinois at Urbana-Champaign in 2020 with a degree in agricultural and biological engineering. She is currently working for her masters in Environmental Engineering. At Langan, she works as a staff engineer and her responsibilities include Phase I and II Environmental Site Assessments (ESAs), soil and groundwater sampling, evaluation, and report processing.

SELECTED PROJECTS

- Rock Run Crossings – Residential, Joliet, IL
- Confidential Casino, Aurora, IL
- Confidential Casino, Joliet, IL
- Millsdale Road – Joliet, Elwood, IL
- Kendall County Solar Project, Plano, IL
- 2345 Hamilton Road, Arlington Heights, IL
- Extra Space Storage, Waukegan, IL
- 509 West Front Street, Roanoke, IL
- New Leaf Energy – Jeffery Road, Kankakee, IL
- New Leaf Energy – E 2000 North Rd, Kankakee, IL
- Melrose Park CNG, Melrose Park, IL
- New Leaf Energy – Off Bastian Rd, Waterman, IL
- New Leaf Energy – Off Kane Rd, Shabbona, IL
- Scout Cold Storage – West 46th and South Damen Ave, Chicago, IL
- NorthPoint – 6500 S US Hwy 421, Westville, IN
- Brookville Road ARS Test-Fit, Indianapolis, IN
- Wasatch Peaks Ranch, Peterson, UT
- Silvercup West, Long Island City, NY
- 50 Hudson Yards – 2 Hudson Blvd, New York, NY
- 74 Bogart Street (2 Ingraham Street), Brooklyn, NY
- 175-225 3rd Street, Brooklyn, NY
- President Street Properties, Brooklyn, NY
- 295 Locust Avenue, Bronx, NY
- 907 E 141st Street, New York, NY
- Breckenridge, MN – LNG, Breckenridge, MN
- Canarsie Park Comfort Station, Brooklyn, NY
- 35-09 Starr Avenue, Long Island City, NY
- 66 North 6th Street, Brooklyn, NY
- 1298 Inwood Avenue, Bronx, NY
- Gateway at Bronx Terminal Market, Bronx, NY
- Saxum Cold/Frozen Storage Warehouse, Romulus, MI
- DKM/Thetford/NFA Investigation, Ann Arbor, MI
- Phase I ESA, Confidential Client, Grand Rapids, MI
- Phase I ESA, Confidential Client, Zion, IL
- Phase I ESA, Confidential Client, Peoria, IL
- Phase I ESA, Confidential Client, Ann Arbor, MI

EDUCATION

B.S., Agricultural and Biological Engineering
University of Illinois at Urbana - Champaign

PROFESSIONAL REGISTRATION

Engineer in Training (EIT) in IL

NICHOLAS HODOM

SENIOR STAFF SCIENTIST

ENVIRONMENTAL ENGINEERING

Mr. Hodom has 7 years of experience with characterization of wastes per state and federal regulation, environmental field and office activities, due diligence efforts, remediation systems operation, technical and regulatory reporting and will be cross trained in geotechnical field observation.

EDUCATION

B.E.S., Environmental Science
State University of New York

SELECTED PROJECTS

- 1 Buckingham Avenue, Perth Amboy, NJ
- 100 Bergen Turnpike, Little Ferry, NJ
- 11 Enterprise Avenue North, Secaucus, NJ
- 1171 Madison Avenue, Paterson, NJ
- 1203 East New York Avenue, Brooklyn, NY
- 132 Prospect Street, Stamford, CT
- 1324 Route 9, Old Bridge, NJ
- 1416 Clinton Hoboken Redevelopment, Hoboken, NJ
- 1500 Clinton, Hoboken, NJ
- 160 Route 17 South, Paramus, NJ
- 1700 Myrtle Avenue, Plainfield, NJ
- 1738-1740 Broadway & 1718 Broadway, West Park, NY
- 180 Baldwin Avenue, Jersey City, NJ
- 1921 Atlantic Avenue, Brooklyn,
- 197 - 207 Van Vorst Street, Jersey City, NJ
- 209 Monticello Avenue, Jersey City, NJ
- 23-30 Borden Avenue, Long Island City, NY
- 24 River Road, Bogota, NJ
- 295 E Main Street, Denville, NJ
- 3 Slater Dr., Elizabeth, NJ
- 301 Hollywood Avenue, South Plainfield, NJ
- 345 Main Street, Madison, NJ
- 3501 Route 66 Due Diligence, Neptune, NJ
- 4 Taft Road, Totowa, NJ
- 40 Quat Street, Brooklyn, NY
- 400 North Woodbury Road, Pitman, NJ
- 408-421 Market Street Redevelopment, Newark, NJ
- 4100 New Brunswick Avenue, Piscataway, NJ
- 425 Summit Avenue, Jersey City, NJ
- 430 Market Street Redevelopment, Newark, NJ
- 49 Fisk Street, Jersey City, NJ
- 50 Jiffy Road, Somerset, NJ
- 50 Journal Square, Jersey City, NJ
- 50 Locust Avenue, Red Bank, NJ
- 502 York Street, Elizabeth, NJ
- 52 Locke Avenue, Woolwich, NJ
- 55 Haul Road, Wayne, NJ
- 59 Fairmount Avenue, North Arlington, NJ

NICHOLAS HODOM

- 60 East 9th Street, New York, NY
- 654 Bergen Avenue, Jersey City, NJ
- 69-07 69th Place, Ridgewood, NY
- 75 Wood Street, Paterson, NJ
- 750 Dowd Avenue, Elizabeth, NJ
- 770 House / 7th And Jackson Resiliency Park, Hoboken, NJ
- 80 Doremus Avenue, Newark, NJ
- 87 Van Horne Street, Jersey City, NJ
- 900 Fairmount, Elizabeth, NJ
- 919 Fairmount, Elizabeth, NJ
- American Dream Meadowlands, East Rutherford, NJ
- Baekeland Avenue Contractor Yard, Middlesex, NJ
- Baker Center, Elizabeth, NJ
- Belleville Logistics Center, Belleville, NJ
- Brixmor, Tinton Falls
- Brodson, Montville, NJ
- Budd Lake Self Storage, Budd Lake, NJ
- Chatham Village, Chatham, NJ
- Connell Corporate Park, Berkeley Heights, NJ
- Former Ballantine Brewery, Newark, NJ
- Former Curtiss-Wright Facility, Wood-Ridge, NJ
- Former Lowe's, Old Bridge, NJ
- Former Sears, Albany, NY
- Fort Lee Development, Fort Lee, NJ
- Fulfillment Center, Budd Lake, NJ
- Hackensack North Jersey Media Group, Hackensack, NJ
- Hackensack University Medical Center, UST Closure, Hackensack, NJ
- Jordan Transportation, Butler, NJ
- Journal Square Towers, Jersey City, NJ
- Lakeland Bank Environmental Review, Fairfield, NJ
- Logistics Center, Bronx, NY
- Maxwell Place, Hoboken, NJ
- Metlife Stadium, East Rutherford, NJ
- Michael Foods, Elizabeth, NJ
- Midland Park Lumber, Midland Park, NJ
- Monroe Center, Hoboken, NJ
- Neumann Leather Redevelopment, Hoboken, NJ
- New Center for Downtown Newark Columbia, Newark, NJ
- Newark Airport, ConRAC Facility, Newark, NJ
- Newark Liberty International Airport (EWR), ConRAC, Newark, NJ
- NJEDA Taxation Building, Trenton, NJ
- NJSEA East and West Groundwater RIR, East Rutherford, NJ
- NJSEA Meadowlands Race Track, Oceanport, NJ
- Novartis, East Hanover, NJ
- NY Life/Bay Avenue, Elizabeth, NJ
- Orange Plaza, Middletown, NY
- Paramus Redevelopment, Paramus, NJ
- Penick, Lyndhurst, NJ
- Realterm, Moonachie, NJ
- Remarkable Foods, Cranford, NJ
- Rescue One New Firehouse, Jersey City, NJ
- Riverside Village, Paterson, NJ

- Saxum 345 Main Street, Madison, NJ
- Seaman Ave Elementary School, Perth Amboy, NJ
- Seaman Avenue Elementary School, Perth Amboy, NJ
- Seton Hall - Athletic Field Stadium, South Orange, NJ
- Sims Municipal Recycling, Brooklyn, NY
- St. Josephs Health Affordable Housing, Paterson, NJ
- Stevens Institute of Technology, Academic Gateway Building, Hoboken, NJ
- Union County Government Complex, Elizabeth, NJ
- Valley National Bank, Various Locations in NJ
- Vogel Medical Center, Eatontown, NJ
- WABC Transmitter, Lodi, NJ
- Warehouse Expansion, Wayne, NJ