PHASE II ENVIRONMENTAL SITE ASSESSMENT REPORT

for

East Adams Redevelopment - Phase VI Area
Radisson Court
Syracuse, New York

Prepared for:

McCormack Baron Salazar Development, Inc. (MBSDI)
100 North Broadway, Suite 100
St. Louis, Missouri 63102

Prepared by:

Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C.
368 Ninth Avenue, 8th Floor
New York, New York 10001



Michael Burke, PG, CHMM
Senior Principal

December 3, 2025
170875901

LANGAN

TABLE OF CONTENTS

1.0 INTRODUCTION 1
2.0 BACKGROUND 2
Site Location and Description 2
Recognized Environmental Conditions 2
Geology 3
Hydrogeology 3
3.0 FIELD INVESTIGATION 4
Geophysical Survey 4
Soil Investigation 4
Groundwater Investigation 5
Soil Vapor Investigation 6
Investigation-Derived Waste Management 7
4.0 OBSERVATIONS AND RESULTS 8
Geophysical Survey 8
Subsurface Observations 8
Soil Sample Results 8
Groundwater Sample Results 9
Soil Vapor Sample Results 10
5.0 FINDINGS AND CONCLUSIONS 12
6.0 RECOMMEDATIONS 13
7.0 LIMITATIONS 14

TABLES
Table 1 Sample Summary
Table 2 Soil Sample Analytical Results
Table 3 Groundwater Sample Analytical Results
Table 4 Soil Vapor Sample Analytical Results

FIGURES
Figure 1 Site Location Map
Figure 2 Boring and Sample Location Map

APPENDICES
Appendix A Previous Environmental Reports
Appendix B Site Photographs
Appendix C Geophysical Survey
Appendix D Soil Boring Logs
Appendix E Monitoring Well Construction Logs
Appendix F Soil Vapor Point Construction and Sampling Logs
Appendix G Laboratory Analytical Reports

1.0 INTRODUCTION

Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C. (Langan) prepared this Phase II Environmental Site Assessment (ESA) report on behalf of McCormack Baron Salazar Development, Inc. (MBSDI) for the East Adams Redevelopment – Phase VI Area property located at Radisson Court in Syracuse, Onondaga County, New York (the "site").

This Phase II ESA was conducted to investigate the recognized environmental conditions (REC) identified in the October 30, 2025 Phase I Environmental Site Assessment (ESA) prepared by Langan and to satisfy United States Department of Housing and Urban Development (HUD) and National Environmental Policy Action (NEPA) requirements.

This Phase II ESA, completed between October 13 and October 17, 2025, included a geophysical survey, advancement of soil borings, installation of temporary groundwater monitoring wells and soil vapor points, and laboratory analysis of soil, groundwater, and soil vapor samples.

This report is organized in the following sections:

- Section 2.0 Background: Describes the site background
- Section 3.0 Field Investigation: Presents the Phase II ESA methodology
- Section 4.0 Observations and Results: Presents the findings of the Phase II ESA
- Section 5.0 Conclusions: Presents conclusions based on the findings
- Section 6.0 Recommendations: Presents recommendations based on the conclusions

2.0 BACKGROUND

Site Location and Description

The about 3-acre site located at Radisson Court (Onondaga County Tax Parcel ID Section 095, Block 12, Lot 01.0 in Syracuse, New York) is part of the Pioneer Homes development and is improved with six 2-story townhome buildings and two 3-story apartment buildings. The site is
2.1 bound by Jackson Street to the north, South McBride Street to the east, East Taylor Street to the south, and South Townsend Street to the west. A Site Location Map is included as Figure 1.

According to the United States Geological Survey (USGS) Syracuse East Quadrangle 7.5-minute Series Topographic Map, the elevation of the site is about 400 feet[1] above mean sea level (msl) and is generally flat. The regional topography slopes downward toward the southwest and Onondaga Creek, which is located approximately 0.5 miles southwest of the site. The site is within an urban area characterized by commercial and residential buildings, private and public institutions, and preserved land.

Recognized Environmental Conditions

2.2 Langan's October 30, 2025 Phase I ESA identified the following RECs/VECs associated with the site.

Historic Infilling of the Site: According to the U.S. Department of Agriculture's (USDA) data for Onondaga County, the site is likely underlain by a layer of non-native fill. Sanborn maps indicate the presence of historical structures that were likely demolished and comingled with non-native fill. Non-native fill found in urban environments typically contains ash, demolition debris, and/or municipal waste products and may contain contaminants (e.g., semi volatile organic compounds [SVOCs] or metals) at concentrations above applicable regulatory standards.

Historical and Current Uses of the Southern Adjoining Property: The southern adjoining property has operated as a steam generation plant since 1926. Multiple underground storage tanks (USTs) and aboveground storage tanks (ASTs) are registered at the adjoining property and it is in the NY Spills database with multiple closed spills. In addition, the adjoining property is listed in the Resource Conservation and Recovery Act (RCRA) generator databases for generation of hazardous waste containing ignitable waste, corrosive waste, spent halogenated solvents used in degreasing, and spent halogenated solvents intermittently over a 22 year period. Undocumented spills or releases of petroleum, solvents, or other hazardous substances associated with operations at this facility may have adversely impacted groundwater and/or soil vapor on the site; therefore, this facility is considered a REC.

Historical Use and Documented Contamination at the Western Surrounding Properties: Historical operations on the western surrounding properties include auto repair, a drycleaner and gasoline filling station from at least 1951 through 1961. The property about 165 feet west and cross-gradient of the site was identified in the NY Spills database under New York State Department of Environmental Conservation (NYSDEC) Spill No. 2400040, which was reported on 2 April 2024 after soil and groundwater impacted with benzene, toluene, ethylbenzene, and xylenes (BTEX)

[1] Elevations in this report refer to North American Vertical Datum of 1988 (NAVD88), which is about 1.1 feet above mean sea level at Sandy Hook, New Jersey.

were identified during a subsurface investigation. According to the spill listing, contamination is likely associated with the former gasoline filling station operations, about 165 feet cross-gradient from the site. Remediation is pending and the spill remains open. The historical use and documented impacts on the western surrounding properties may have impacted soil vapor at the site and this listing is therefore considered a VEC.

The Phase I ESA is provided as Appendix A.

Geology

2.3 According to the USDA Natural Resources Conservation Service (NRCS) Soil Survey Geographic (SSURGO) data for the site, soil is comprised primarily of urban land. Urban land is described as excavated, filled, and made land.

Based on review of the USGS "Geologic Map of New York, Finger Lakes Sheet (Fisher, Isachsen, Rickard, dated March 1970)", the site is underlain by bedrock of the Syracuse Foundation, consisting of dolostone, shale, gypsum and salt. Geological surface features (e.g., rock outcroppings) were not observed.

Hydrogeology

2.4 Groundwater flow is typically topographically influenced because shallow groundwater tends to originate in areas of topographic highs and flow toward areas of topographic lows, such as rivers, stream valleys, ponds, and wetlands. A broader, interconnected hydrogeologic network often governs groundwater flow at depth or in the bedrock aquifer. Groundwater depth and flow direction are also subject to hydrogeologic and anthropogenic variables such as precipitation, evaporation, extent of vegetative cover, and coverage by impervious surfaces. Other factors influencing groundwater include depth to bedrock, artificial fill, and variability in local geology and groundwater sources or sinks. Langan observed groundwater between about 6.5 and 9.5 feet below grade surface (bgs) during the Phase II ESA. Based on topographic gradient and proximity to Onondaga Creek, it is expected that groundwater generally flows to the southwest.

3.0 FIELD INVESTIGATION

The Phase II ESA included a geophysical survey, advancement of ten soil borings, and installation of four temporary groundwater monitoring wells and four temporary soil vapor points across the site. Soil, groundwater, soil vapor, and ambient air samples were collected for laboratory analysis. The Phase II ESA field work was completed between October 13 and October 17, 2025.

Soil boring, monitoring well, soil vapor and ambient air sampling locations are shown on Figure 2, and a summary of samples and associated laboratory analyses is included as Table 1. A photograph log documenting the Phase II ESA is included as Appendix B.

Geophysical Survey

3.1 Prior to intrusive sampling, SoftDig Underground Services Inc, (SoftDig) of Westchester, Pennsylvania completed a geophysical survey of proposed sample areas between October 13 and 15, 2025. The survey included ground-penetrating radar (GPR) and electromagnetic (EM) detectors to locate potential subsurface utilities, underground storage tanks, and subsurface structures in the vicinity of proposed boring locations. A copy of the geophysical survey is included in Appendix C.

Soil Investigation

3.2 Ten soil borings (P6SB01 through P6SB10) were advanced by Nothnagle Drilling Inc, (Nothnagle) of Scottsville, New York between October 13 and October 17, 2025. Langan field personnel were on-site to document field observations and collect soil samples. Soil borings were advanced using a Geoprobe 6712DT direct push drill rig to about 10 to 15 feet bgs. Soil samples were collected continuously into 4-foot-long Macrocore® sample barrels lined with dedicated acetate sleeves. Langan collected surficial soil samples (0 to 2-foot interval) from each boring location using a decontaminated hand auger.

Soil samples were visually classified for soil type, grain size, texture, and moisture content, and screened for visual, olfactory, and instrumental evidence of a chemical or petroleum release. Instrumental screening for the presence of organic vapors was performed using a photoionization detector (PID) equipped with a 10.6 electron volt (eV) lamp. Two soil samples were collected from each boring location. The first sample at each location was collected from 0 to 2 feet bgs, and the second sample was collected from a representative location in the uncontrolled fill layer.

Samples submitted for analysis of volatile organic compounds (VOC) were collected directly from the auger bucket or acetate liner into laboratory-supplied TerraCore® soil samplers. The remaining sample volume was homogenized and placed in laboratory-supplied containers for additional analyses. The sample containers were labeled, placed in a laboratory-supplied cooler, and packed on ice to attempt to maintain a temperature of about 4°C. The samples were picked up and delivered by courier to Pace Analytical, Inc. (Pace) under standard chain-of-custody protocol. Pace is a New York State Department of Health (NYSDOH) Environmental Laboratory Approval Program (ELAP)-certified laboratory in Westborough, Massachusetts.

Soil samples were analyzed using one or more of the following methods:

- NYSDEC Part 375 List and Target Compound List (TCL) VOCs by United States Environmental Protection Agency (USEPA) method 8260D
- NYSDEC Part 375 list and TCL semivolatile organic compounds (SVOC) by USEPA method 8270E
- Polychlorinated biphenyls (PCB) by USEPA method 8082A
- NYSDEC Part 375 list and TCL Pesticides by USEPA method 8081B
- NYSDEC Part 375 list and TCL Herbicides by USEPA method 8151A
- Target Analyte List (TAL) metals (including hexavalent and trivalent chromium and cyanide) by USEPA methods 6010D, 7196A, 7471B, 9010C, and 9012B.

After sample collection, Nothnagle backfilled borings with non-impacted soil cuttings or No. 2 clean sand and patched each location with asphalt or topsoil. Soil boring logs are included in Appendix D.

Groundwater Investigation

3.3 Nothnagle converted four soil borings (P6SB02, P6SB03, P6SB09, and P6SB10) into temporary groundwater monitoring wells (P6TMW02, P6TMW03, P6TMW09, and P6TMW10). Monitoring wells consisted of about ten feet of one-inch polyvinyl chloride (PVC) 10-slot (0.010-inch) well screen connected to solid 1-inch PVC riser pipe to about 1.5 feet above grade surface (ags). The well screen for temporary monitoring well P6TMW09 was installed from about 4 to 14 feet bgs, and the well screens for temporary monitoring wells P6TMW02, P6TMW03, and P6TMW10 were installed from about 5 to 15 feet bgs. The annular space of the monitoring well was backfilled with No. 2 sand to about one foot above the screened interval. Monitoring well construction logs are included in Appendix E.

Langan collected one groundwater sample from each monitoring well for laboratory analyses. Monitoring wells were gauged with an oil-water interface probe to record a depth to groundwater reading and to gauge for free product. Well headspaces were screened with a PID. Due to poor recharge conditions, the monitoring wells were purged for one recharge cycle prior to collecting the sample. Groundwater quality parameters (pH, conductivity, turbidity, dissolved oxygen, temperature, and oxidation-reduction potential) could not be measured. After sampling, Nothnagle removed each temporary monitoring well and backfilled the borehole with clean cuttings.

Groundwater samples were collected with a peristaltic pump and dedicated polyethylene tubing directly from the pump effluent into laboratory-supplied containers. Samples submitted for dissolved-metal analysis were filtered in the field using a 0.45-micron filter. Purged groundwater was containerized into a labeled 55-gallon drum staged at the East Adams Redevelopment – Phase VIII Area property for future off-site disposal at a permitted facility (Section 3.5).

The sample containers were labeled, placed in a laboratory-supplied cooler, packed on ice to maintain a temperature of about 4 °C, and delivered by courier to Pace Analytical under standard chain-of-custody protocol.

Groundwater sample analyses included:

- NYSDEC Part 375 list and TCL VOCs by USEPA method 8260D
- NYSDEC Part 375 list and TCL SVOCs by USEPA method 8270E
- PCBs by USEPA method 8082A
- Total and dissolved TAL metals, hexavalent chromium, trivalent chromium, and total cyanide by USEPA methods 6010D, 6020B, 7470A, 7196A, 9010C, and 9012B

Soil Vapor Investigation

3.4 Nothnagle installed four soil vapor points (P6SV02, P6SV03, P6SV09, and P6SV10) in accordance with the October 2006 NYSDOH Guidance for Evaluating Soil Vapor Intrusion in the State of New York and subsequent updates (2017, 2024). Dedicated soil vapor implants were installed to about 4 feet bgs (P6SV02, P6SV09, P6SV10) or 5 feet bgs (P6SV03) using a track-mounted Geoprobe 6712DT drill rig. Each soil vapor collection probe consisted of a 6-inch stainless steel probe and Teflon-lined polyethylene tubing. The annulus around the soil vapor implant and tube was filled with a clean, coarse sand pack followed by a hydrated bentonite seal to surface grade. Hydrated bentonite was also used to create a seal around the tubing at the surface of the soil vapor point.

A helium tracer gas was used in accordance with the NYSDOH protocols to serve as quality assurance/quality control (QA/QC) technique to document the integrity of the seal at each sampling point before and after sampling. The tracer gas was introduced into an overturned container that was sealed at the ground surface with bentonite, which acted as a shroud for the vapor point and seal. Helium was measured from the sampling tube and inside the container with an MGD-2002 helium-leak detector. If the sample tube contained more than 10% of the tracer gas concentration introduced into the container, the seal was considered compromised and was enhanced or reconstructed to reduce air infiltration in the subsurface. All sample points had sufficiently tight seals.

Before collecting vapor samples, a minimum of three implant volumes (i.e., the volume of the sample probe and tube) were purged from each sample port at a rate of 250 milliliters per minute using a RAE Systems MultiRAE® Plus meter. The purged soil vapor was monitored for VOCs during purging using the MultiRAE® Plus meter.

One ambient air sample (P6AA01) was collected for the duration of soil vapor samples. P6AA01 was collected 4 feet above the ground to represent the breathing zone.

Soil vapor and ambient air samples were collected into laboratory-supplied, batch-certified clean, 6-liter Summa® canisters with flow controllers calibrated for a 2-hour sample interval. Summa® canisters were labeled and delivered by courier to Pace under standard chain-of-custody protocol. Soil vapor and ambient-air samples were analyzed for VOCs by USEPA Method TO-15.

After sample collection, the sampling media (probes, tubes, etc.) were removed, the sample locations were backfilled to grade with clean soil cuttings, clean sand, and/or bentonite grout, and the holes were patched at grade with asphalt or topsoil. Soil vapor point construction logs and soil vapor and ambient air sampling logs are included in Appendix F.

Investigation-Derived Waste Management

Langan containerized investigation-derived waste (IDW), consisting of purged groundwater, into one labelled and sealed 55-gallon drum. The drum is staged at the East Adams Redevelopment – Phase VIII Area site pending transport by a licensed waste hauler for disposal at an approved facility.

3.5

4.0 OBSERVATIONS AND RESULTS

Geophysical Survey

The geophysical survey identified municipal drainage, electric, gas, sewer, telecom, and water lines entering the site to the north, east, and west from Jackson Street, South McBride Street, and South Townsend Street, respectively. Geophysical anomalies indicative of USTs were not
4.1 identified; however, subsurface interference was encountered throughout the site due to subsurface conditions. A copy of the geophysical survey is included in Appendix C.

Subsurface Observations

The site is underlain by uncontrolled fill, predominantly consisting of gray to brown fine-grained
4.2 sand with varying amounts of silt, clay, gravel, construction debris, coal, metal, glass, and fibrous vegetation that extends from grade surface to about 2 to 5.6 feet bgs. Layers of gray and/or brown clay and fine-grained sand were observed below the uncontrolled fill layer. Evidence of a chemical or petroleum release (i.e., visual, olfactory, and/or PID readings above 0.0 parts per million [ppm]) were not observed in the boring locations. Bedrock was not encountered during the Phase II ESA.

Groundwater was encountered between 6.5 to 9.5 feet bgs in monitoring wells across the site. The well headspaces were screened with a PID prior to purging; evidence of impacts was not detected and purged groundwater did not exhibit a sheen or odor. Poor groundwater recharge in temporary wells was site-wide, likely due to the dense clay material encountered in soil borings. The inferred regional groundwater flow direction for the area surrounding the site is to the
4.3 southwest.

Soil Sample Results

Soil sample analytical results were compared to the NYSDEC Title 6 of the New York Codes, Rules and Regulations (NYCRR) Part 375 Unrestricted Use (UU) and Restricted Use Restricted-Residential (RURR) Soil Cleanup Objectives (SCO). Ranges of compounds detected at concentrations above the SCOs are listed below. RURR SCO exceedances are in bold text.

<u>SVOCs</u>

- Benzo(a)anthracene: **1.4 milligrams per kilogram (mg/kg)** in P6SB07_2-3 to **56 mg/kg** in P6SB01_0-1
- Benzo(a)pyrene: **1.5 mg/kg** in P6SB07_2-3 to **49 mg/kg** in P6SB01_0-1
- Benzo(b)fluoranthene: **1.8 mg/kg** in P6SB07_2-3 to **65 mg/kg** in P6SB01_0-1
- Benzo(k)fluoranthene: 0.84 mg/kg in P6SB06_0-1 to **16 mg/kg** in P6SB01_0-1
- Chrysene: 1.2 mg/kg in P6SB07_2-3 to **48 mg/kg** in P6SB01_0-1
- Dibenz(a,h)anthracene: **0.39 mg/kg** in P6SB08_0-1 to **6.2 mg/kg** in P6SB01_0-1
- Dibenzofuran: 12 mg/kg in P6SB01_0-1
- Fluoranthene: **120 mg/kg** in P6SB01_0-1
- Indeno(1,2,3-cd)pyrene: **0.73 mg/kg** in P6SB07_2-3 to **32 mg/kg** in P6SB01_0-1
- Phenanthrene: **120 mg/kg** in P6SB01_0-1

Pesticides

- 4,4'-DDD: 0.00908 mg/kg in P6SB07_1-2
- 4,4'-DDE: 0.00723 mg/kg in P6SB03_1-2 to 0.0239 mg/kg in P6SB10_0-1
- 4,4'-DDT: 0.00434 mg/kg in P6SB03_1-2 to 0.0224 mg/kg in P6SB08_0-1
- Dieldrin: 0.00579 mg/kg in P6SB01_0-1

Metals

- Barium: **587 mg/kg** in P6SB05_1-2
- Copper: 51.5 mg/kg in P6SB07_2-3 to 198 mg/kg in P6SB05_1-2
- Lead: 130 mg/kg in P6SB04_4-5 to **1,600 mg/kg** in P6SB05_1-2
- Mercury: 0.213 mg/kg in P6SB08_0-1 to **1.01 mg/kg** in P6SB03_1-2
- Nickel: 33.5 mg/kg in P6SB02_3-4 to 50.7 mg/kg in P6SB02_1-2
- Zinc: 112 mg/kg in P6SB04_0-1 to 653 mg/kg in P6SB05_1-2

Herbicides and VOCs were not identified at concentrations above the UU or RURR SCOs. Soil sample analytical results are shown in Table 2 and analytical laboratory reports are included in Appendix G.

4.4 Groundwater Sample Results

Groundwater sample analytical results were compared to the NYSDEC Title 6 NYCRR Part 703.5 and the NYSDEC Technical and Operational Guidance Series (TOGS) 1.1.1 Ambient Water Quality Standards and Guidance Values for Class GA water (collectively referred to as SGVs).

SVOCs

Six SVOCs were identified at concentrations exceeding the SGVs. Ranges of compounds detected at concentrations above the SGVs are listed below:

- Benzo(a)anthracene: 0.04 µg/L in P6TMW03 to 0.24 µg/L in P6TMW02
- Benzo(a)pyrene: 0.2 µg/L in P6TMW02
- Benzo(b)fluoranthene: 0.25 µg/L in P6TMW02
- Benzo(k)fluoranthene: 0.09 µg/L in P6TMW02
- Chrysene: 0.19 µg/L in P6TMW02
- Indeno(1,2,3-cd)pyrene: 0.1 µg/L in P6TMW02

All six SVOCs were also identified in soil above the Protection of Groundwater (PGW) SCOs.

Total Metals

Five total metals were identified at concentrations exceeding the SGVs. Ranges of compounds detected at concentrations above the SGVs are listed below:

- Iron: 31,000 µg/L in P6TMW02 to 45,700 µg/L in P6TMW03
- Lead: 32.74 µg/L in P6TMW02 to 60.24 µg/L in P6TMW03
- Magnesium: 87,800 µg/L in P6TMW02 to 181,000 µg/L in P6TMW03
- Manganese: 1,498 µg/L in P6TMW02 to 3,629 µg/L in P6TMW03
- Sodium: 52,700 µg/L in P6TMW03 to 596,000 µg/L in P6TMW02

Dissolved Metals

Three dissolved metals were identified at concentrations exceeding the SGVs. Ranges of compounds detected at concentrations above the SGVs are listed below:

- Magnesium: 64,600 µg/L in P6TMW02
- Manganese: 719.6 µg/L in P6TMW03 to 1,114 µg/L in P6TMW02
- Sodium: 53,600 µg/L in P6TMW03 to 630,000 µg/L in P6TMW02

Due to low sample volume, groundwater samples P6TMW09 and P6TMW10 were only analyzed for TCL VOCs. VOCs were not detected at concentrations above the SGVs. Groundwater sample analytical results are shown in Table 3 and analytical laboratory reports are included in Appendix G.

Soil Vapor Sample Results

4.5 There are no standards established for soil vapor in New York State; however, the NYSDOH has developed guidance documents addressing the risk of vapor intrusion into buildings from detected concentrations. The soil vapor and ambient air sample results were compared to the Decision Matrices provided in the October 2006 NYSDOH Guidance for Evaluating Soil Vapor Intrusion in the State of New York Decision Matrices for Sub-Slab Vapor and Indoor Air and subsequent updates (2017, 2024).

NYSDOH Decision Matrices evaluate eight chlorinated volatile organic compounds (CVOC) and 13 petroleum-related VOCs using six matrices that evaluate the relationship between soil vapor and indoor air concentrations and provide recommendations for actions such as monitoring or mitigation. Soil vapor samples were compared against the matrix values for which monitoring or mitigation may be recommended; however, these recommendations are dependent not only on sub-slab concentrations but also on indoor air concentrations.

Total VOCs detected in soil vapor samples ranged between 1,801.461 micrograms per cubic meter (µg/m^3) in P6SV02 to 3,448.89 µg/m^3 in P6SV09.

Of the eight CVOCs and 13 petroleum-related VOCs that were evaluated using the NYSDOH Decision Matrices, 1,2,4-trimethlybenzene (1,2,4-TMB), 1,3,5-trimethylbenzene (1,3,5-TMB), 2,2,4-trimethylpentane (2,2,4-TMP), benzene, cyclohexane, ethylbenzene, m,p-xylene, n-heptane, n-hexane, o-xylene, and toluene were detected in soil vapor. The following is a summary of concentration ranges for the detected matrix compounds in soil vapor samples.

Compound	NYSDOH Decision Matrices Minimum Concentration (µg/m³)[1]	Soil Vapor Concentration Range (µg/m³)	Number of Detections
1,2,4-TMB	60	1.98 (P6SV02)	1
1,3,5-TMB	60	1.5 (P6SV02)	1
2,2,4-TMP	60	63.1 (P6SV02)	1
Benzene	60	1.39 (P6SV09) to 6.84 (P6SV02)	2
Cyclohexane	60	26.1 (P6SV02)	1
Ethylbenzene	60	1.41 (P6SV02)	1
m,p-Xylene	200	4 (P6SV02)	1
n-Heptane	200	15 (P6SV09) – 55.7 (P6SV02)	4
n-Hexane	200	12.3 (P6SV03) – 84.2 (P6SV02)	4
o-Xylene	60	3 (P6SV02)	1
Toluene	300	1.79 (P6SV09) to 7.16 (P6SV02)	2

1. µg/m³ – microgram per cubic meter

With the exception of 2,2,4-TMP, no further action is recommended when the above-listed compounds are evaluated against the minimum mitigation threshold concentrations using the NYSDOH Decision Matrices; however, when 2,2,4-TMP is evaluated against the Matrices, mitigation is among the potential recommendations. The Phase II investigation did not include the collection of indoor air samples so the matrix could not be applied as fully intended in the guidance.

Soil vapor and ambient air sample analytical results are shown in Table 4 and analytical laboratory reports are included in Appendix G.

5.0 FINDINGS AND CONCLUSIONS

The following is a summary of Phase II ESA findings and conclusions:

- The geophysical survey identified municipal drainage, electric, gas, sewer, telecom, and water, unknown utility, and DOT lines entering and throughout the site. Geophysical anomalies indicative of USTs were not identified.
- The site is underlain by non-native fill, predominantly consisting of grey to brown fine-grained sand with varying amounts of silt, clay, gravel, construction debris, coal, metal, glass, and fibrous vegetation. Layers of gray and/or brown clay and fine-grained sand were observed below the uncontrolled fill layer. Bedrock was not encountered during the Phase II ESA. Evidence of a petroleum or chemical release (i.e., odors, staining, organic vapors) was not observed in the borings.
- Soil analytical results identified SVOCs, pesticides, and metals above the UU and/or RURR SCOs, which may be attributed to historical infilling of the site.
- SVOCs and total lead identified above SGVs in groundwater samples may be the result of fill entrainment and/or impacts related to historical site operations.
- Total and dissolved magnesium, manganese, and sodium were identified above SGVs in groundwater samples. These results are consistent with regional groundwater quality and are not indicative of a release.
- Total VOCs were detected in soil vapor at concentrations ranging from 1,801.461 µg/m3 in P6SV02 to 3,448.89 µg/m3 in P6SV09. When soil vapor concentrations are evaluated against the minimum mitigation threshold concentrations using the NYSDOH Decision Matrices, potential recommendations range between "no further action" to "mitigate" for occupied structures, with mitigation being recommended for 2,2,4-TMP. Soil vapor impacts may be attributed to the historical use of the property and/or an off-site source.

6.0 RECOMMENDATIONS

SVOCs and metals were detected at concentrations exceeding RURR SCOs throughout the site. At a minimum, these areas should be delineated, excavated and removed from the site as part of future development in accordance with MBSDI policy. Any soil exported from the property during construction must be characterized, profiled, and properly disposed in accordance with the project specifications and applicable local, state, and federal regulations, including the revised Title 6 of the New York Codes, Rules, and Regulations (NYCRR) Part 360. Trucks used to haul material off-site may require NYSDEC Part 364 transporter permits and should be considered prior to any off-site soil disposal.

SVOCs and total metals identified in groundwater above SGVs are consistent with contaminants identified in soil samples. Concentrations of total and dissolved magnesium, manganese, and sodium in groundwater are consistent with regional groundwater conditions; therefore, no further action is recommended. If groundwater is encountered and dewatering is required, the contractor shall obtain applicable local and/or state discharge permits.

Petroleum-related VOCs were identified in soil vapor at concentrations that may warrant mitigation. Installation of an active sub-membrane depressurization system (SMDS) beneath future structures is recommended to mitigate potential for vapor intrusion. Indoor air testing may be required prior to building occupancy to ensure adequate vacuum conditions beneath the building foundation. The system should also be compatible with requirements for radon mitigation systems, as the site is located with Radon Zone 1.

Based on the presence of contaminants of concern in soil and soil vapor above applicable regulatory standards related to former historical operations of the site, application to the NYSDEC Brownfield Cleanup Program (BCP) is recommended.

7.0 LIMITATIONS

This report was prepared expressly for MBSDI for the East Adams Redevelopment - Phase VI Area property, located at Radisson Court in Syracuse, New York, and for the objectives defined here. Special risks occur whenever engineering or related disciplines are applied to identify subsurface conditions. Even a comprehensive sampling and testing program implemented in accordance with a professional standard of care may fail to detect certain conditions. The environmental, geologic, geotechnical, geochemical, and hydrogeologic conditions that Langan interprets to exist between sampling points may differ from those that actually exist. Actual conditions will vary from those encountered at the locations where borings, sampling, surveys, observations or explorations are made by Langan or its subcontractors and the data, interpretation, and recommendations of Langan are based solely on the information available to it. Furthermore, the passage of time, natural occurrences, and/or direct or indirect human intervention at or near the site may substantially alter discovered conditions. Langan cannot be responsible for interpretations by others of the information Langan develops or provides to MBSDI without specific written authorization from Langan.

FIGURES

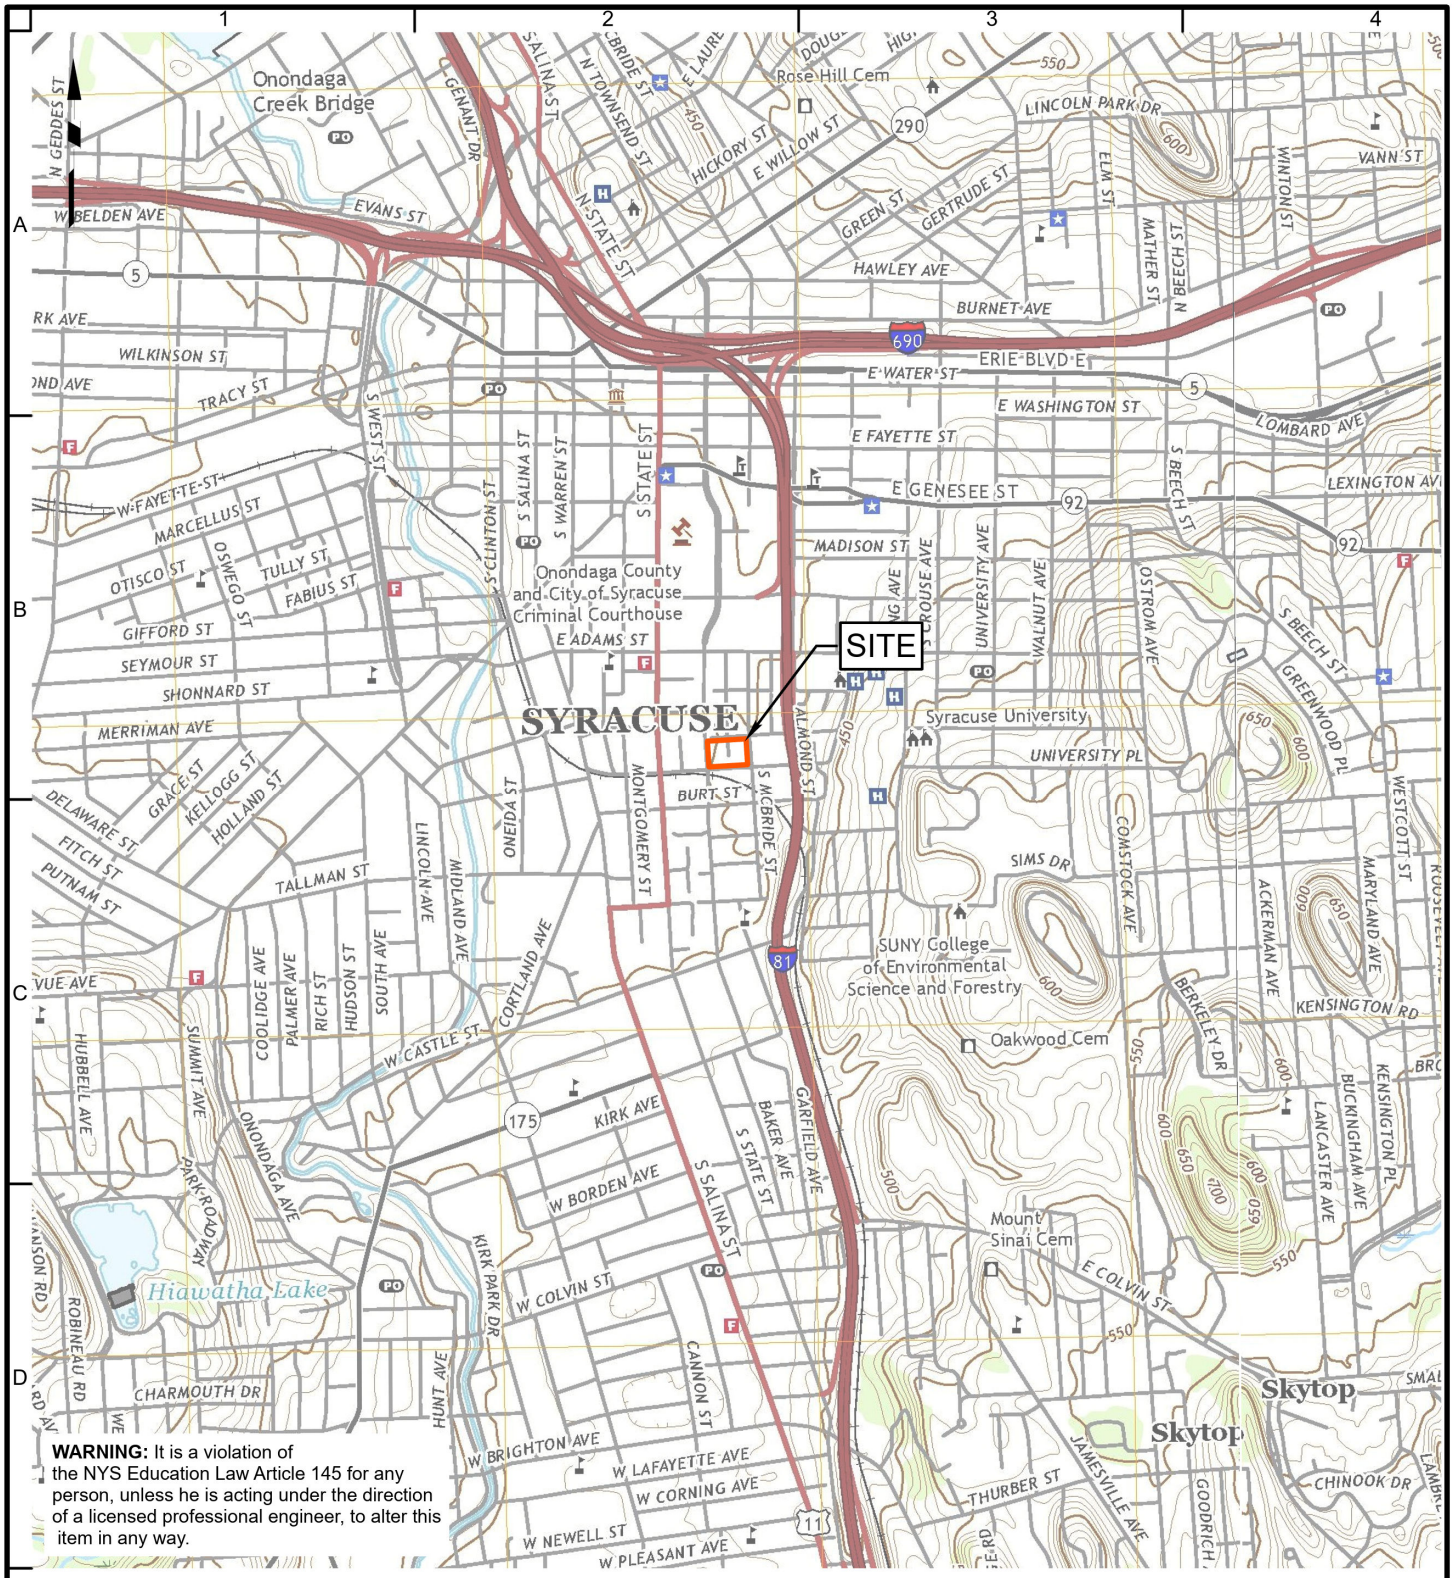

Legend

Approximate Site Boundary

2,000 0 2,000

SCALE IN FEET

Notes:

1. Basemap adapted from United States Geological Survey (USGS) 7.5-Minute Series Topographical Maps, Syracuse West, New York, Quadrangle.

LANGAN

Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C.

368 Ninth Avenue, 8th Floor
New York, NY 10001-2727

T: 212.479.5400 F: 212.479.5444
www.langan.com

Project	Figure Title	Project No.	Figure
EAST ADAMS REDEVELOPMENT - PHASE VI AREA SYRACUSE ONONDAGA COUNTY NEW YORK	SITE LOCATION MAP	170859701	1
		Date: 10/30/2025	
		Scale: 1" = 2,000'	
		Drawn By: GS	

© 2025 Langan

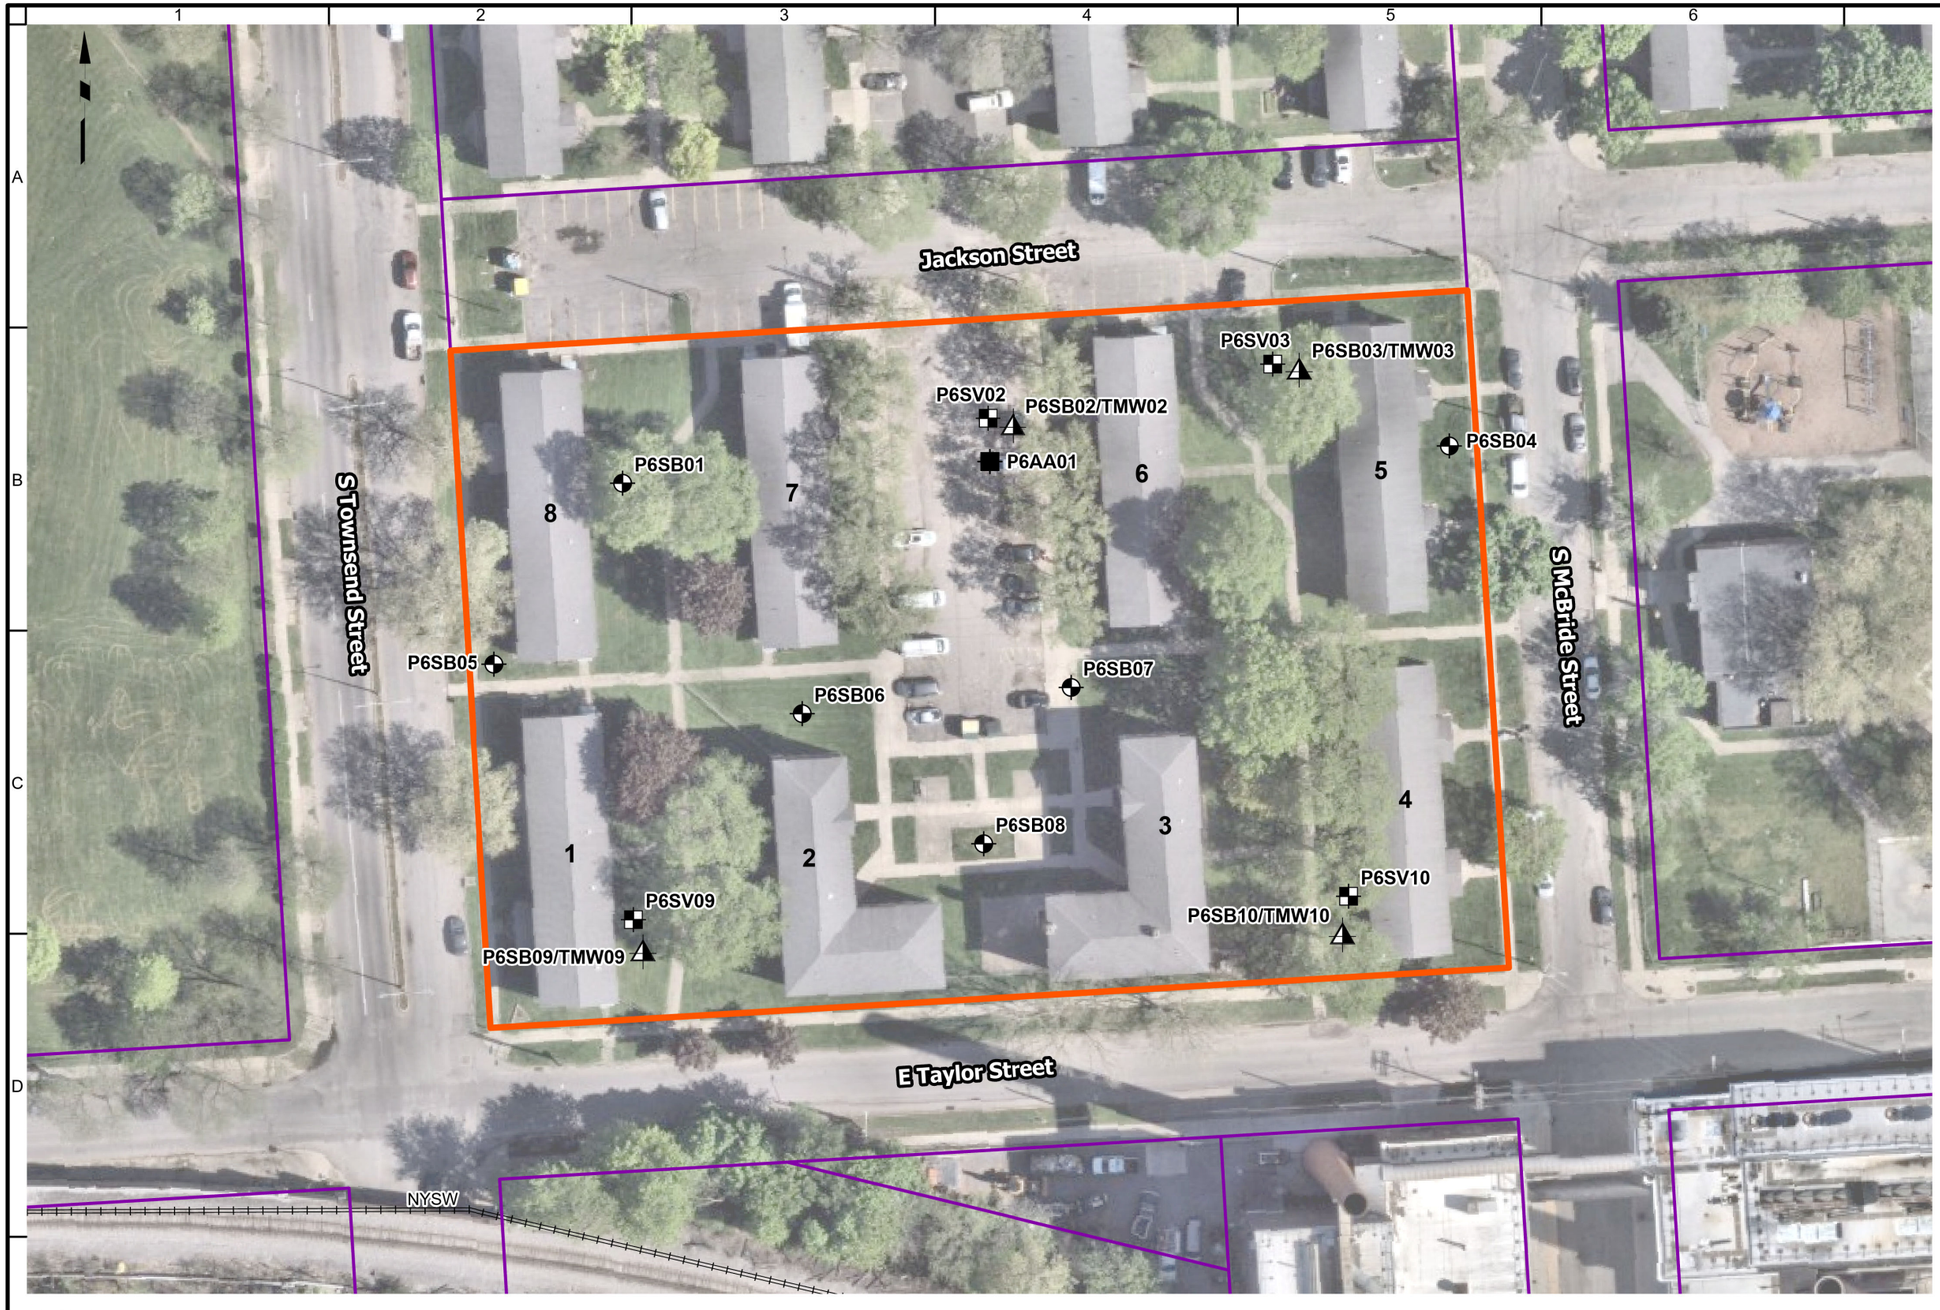

Legend

- Site Boundary
- Parcel Boundary
- Rail Lines
- 6 Building Number
- Soil Boring Location
- Soil Boring/Temporary Monitoring Well Location
- Soil Vapor Point Location
- Ambient Air Sample Location

Notes:
1. Aerial imagery provided through Langan's subscription to Near Map, dated 04/30/2025.
2. Parcel data provided by Onondaga County.
3. All locations are approximate.

WARNING: It is a violation of the NYS Education Law Article 145 for any person, unless he is acting under the direction of a licensed professional engineer, to alter this item in any way.

60 0 60
SCALE IN FEET

LANGAN
Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C.
368 Ninth Avenue, 8th Floor
New York, NY 10001-2727
T: 212.479.5400 F: 212.479.5444 www.langan.com

Project
EAST ADAMS REDEVELOPMENT - PHASE VI AREA
SYRACUSE
ONONDAGA COUNTY NEW YORK

Figure Title
BORING AND SAMPLE LOCATION MAP

Project No. 170859701
Date 10/30/2025
Scale 1"=60'
Drawn By GS

Figure 2

© 2025 Langan

Path: \\langan.com\data\NYC\data7\170859701\Project Data\ArcGIS\APRX\170859701 Phase 4-12\170859701 Phase 4-12_PHII\170859701 Phase 4-12_PHII.aprx Date: 10/30/2025 User: Gsajbel Time: 12:57 PM

TABLES

Table 1
Phase II Environmental Site Assessment Report
Sample Summary

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

No.	Boring	Sample Name	Sample Date	Rationale	Depth (bgs)	Analyses
SOIL						
1	P6SB01	P6SB01_0-1	10/16/2025	Surficial Sample	0-1	Part 375/TCL VOCs, SVOCs, PCBs, Pesticides, Herbicides, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
2		P6SB01_5-6	10/16/2025	Native Soil	5-6	Part 375/TCL VOCs, SVOCs, PCBs, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
3	P6SB02	P6SB02_1-2	10/16/2025	Surficial Sample	1-2	Part 375/TCL VOCs, SVOCs, PCBs, Pesticides, Herbicides, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
4		P6SB02_3-4	10/16/2025	Native Soil	3-4	Part 375/TCL VOCs, SVOCs, PCBs, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
5	P6SB03	P6SB03_1-2	10/15/2025	Surficial Sample	1-2	Part 375/TCL VOCs, SVOCs, PCBs, Pesticides, Herbicides, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
6		P6SB03_4-5	10/15/2025	Native Soil	4-5	Part 375/TCL VOCs, SVOCs, PCBs, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
7	P6SB04	P6SB04_0-1	10/15/2025	Surficial Sample	0-1	Part 375/TCL VOCs, SVOCs, PCBs, Pesticides, Herbicides, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
8		P6SB04_4-5	10/15/2025	Native Soil	4-5	Part 375/TCL VOCs, SVOCs, PCBs, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
9	P6SB05	P6SB05_1-2	10/16/2025	Surficial Sample	1-2	Part 375/TCL VOCs, SVOCs, PCBs, Pesticides, Herbicides, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
10		P6SB05_5-6	10/16/2025	Native Soil	5-6	Part 375/TCL VOCs, SVOCs, PCBs, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
11	P6SB06	P6SB06_0-1	10/15/2025	Surficial Sample	0-1	Part 375/TCL VOCs, SVOCs, PCBs, Pesticides, Herbicides, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
12		P6SB06_4-5	10/15/2025	Native Soil	4-5	Part 375/TCL VOCs, SVOCs, PCBs, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
13	P6SB07	P6SB07_1-2	10/15/2025	Surficial Sample	1-2	Part 375/TCL VOCs, SVOCs, PCBs, Pesticides, Herbicides, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
14		P6SB07_2-3	10/15/2025	Fill Layer	2-3	Part 375/TCL VOCs, SVOCs, PCBs, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
15	P6SB08	P6SB08_0-1	10/16/2025	Surficial Sample	0-1	Part 375/TCL VOCs, SVOCs, PCBs, Pesticides, Herbicides, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
16		P6SB08_2-3	10/16/2025	Fill Layer	2-3	Part 375/TCL VOCs, SVOCs, PCBs, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
17	P6SB09	P6SB09_1-2	10/16/2025	Surficial Sample	1-2	Part 375/TCL VOCs, SVOCs, PCBs, Pesticides, Herbicides, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
18		P6SB09_3-4	10/16/2025	Fill Layer	3-4	Part 375/TCL VOCs, SVOCs, PCBs, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
19	P6SB10	P6SB10_0-1	10/15/2025	Surficial Sample	0-1	Part 375/TCL VOCs, SVOCs, PCBs, Pesticides, Herbicides, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
20		P6SB10_2-3	10/15/2025	Native Soil	2-3	Part 375/TCL VOCs, SVOCs, PCBs, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium), Total Cyanide
GROUNDWATER						
1	P6TMW02	P6TMW02_101625	10/16/2025	Screened interval	-	Part 375/TCL VOCs, SVOCs, PCBs, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium, total and dissolved), Total Cyanide
2	P6TMW03	P6TMW03_101525	10/15/2025	Screened interval	-	Part 375/TCL VOCs, SVOCs, PCBs, Part 375/TAL Metals (including Hexavalent/Trivalent Chromium, total and dissolved), Total Cyanide
3	P6TMW09	P6TMW09_101625	10/16/2025	Screened interval	-	Part 375/TCL VOCs
4	P6TMW10	P6TMW10_101625	10/16/2025	Screened interval	-	
AIR						
1	P6SV02	P6SV02_101625	10/16/2025	5 feet bgs	-	TO-15 VOCs
2	P6SV03	P6SV03_101625	10/16/2025	5 feet bgs	-	
3	P6SV09	P6SV09_101625	10/16/2025	5 feet bgs	-	
4	P6SV10	P6SV10_101625	10/16/2025	5 feet bgs	-	
5	P6AA01	P6AA01_101625	10/16/2025	Breathing height	-	

Notes:

1. Soil and groundwater samples were analyzed for New York State Department of Environmental Conservation (NYSDEC) Title 6 of the Official Compilation of New York Codes, Rules and Regulations {6 NYCRR} Part 375-list compounds
2. Soil vapor samples were analyzed for United States Environmental Protection Agency (USEPA) Toxic Organics (TO)-15 compouds
3. VOC = volatile organic compound
4. SVOC = semivolatile organic compound
5. PCB = polychlorinated biphenyl
6. TCL = Target Compound List
7. TAL = Target Analyte List
8. bgs = below grade surface

Table 2
Phase II Environmental Site Assessment Report
Soil Sample Analytical Results

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

Analyte	CAS Number	NYSDEC Part 375 Unrestricted Use SCOs	NYSDEC Part 375 Restricted Use Restricted-Residential SCOs	Location	P6SB01	P6SB01	P6SB02	P6SB02	P6SB03	P6SB03	P6SB04	P6SB04	P6SB05	P6SB05
				Sample Name	P6SB01_0-1	P6SB01_5-6	P6SB02_1-2	P6SB02_3-4	P6SB03_1-2	P6SB03_4-5	P6SB04_0-1	P6SB04_4-5	P6SB05_1-2	P6SB05_5-6
				Sample Date	10/16/2025	10/16/2025	10/16/2025	10/16/2025	10/15/2025	10/15/2025	10/15/2025	10/15/2025	10/16/2025	10/16/2025
				Sample Depth	0-1	5-6	1-2	3-4	1-2	4-5	0-1	4-5	1-2	5-6
				Unit	Result	Result	Result	Result	Result	Result	Result	Result	Result	Result
Volatile Organic Compounds														
1,1,1,2-Tetrachloroethane	630-20-6	NS	NS	mg/kg	<0.00086 U	<0.0005 U	<0.00074 U	<0.00092 U	<0.00088 U	<0.00073 U	<0.00096 U	<0.00076 U	<0.00098 U	<0.00046 U
1,1,1-Trichloroethane	71-55-6	0.68	100	mg/kg	<0.00086 U	<0.0005 U	<0.00074 U	<0.00092 U	<0.00088 U	<0.00073 U	<0.00096 U	<0.00076 U	<0.00098 U	<0.00046 U
1,1,2,2-Tetrachloroethane	79-34-5	NS	NS	mg/kg	<0.00086 U	<0.0005 U	<0.00074 U	<0.00092 U	<0.00088 U	<0.00073 U	<0.00096 U	<0.00076 U	<0.00098 U	<0.00046 U
1,1,2-Trichloroethane	79-00-5	NS	NS	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
1,1-Dichloroethane	75-34-3	0.27	26	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
1,1-Dichloroethene	75-35-4	0.33	100	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
1,1-Dichloropropene	563-58-6	NS	NS	mg/kg	<0.00086 U	<0.0005 U	<0.00074 U	<0.00092 U	<0.00088 U	<0.00073 U	<0.00096 U	<0.00076 U	<0.00098 U	<0.00046 U
1,2,3-Trichlorobenzene	87-61-6	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
1,2,3-Trichloropropane	96-18-4	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
1,2,4,5-Tetramethylbenzene	95-93-2	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
1,2,4-Trichlorobenzene	120-82-1	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
1,2,4-Trimethylbenzene	95-63-6	3.6	52	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
1,2-Dibromo-3-Chloropropane	96-12-8	NS	NS	mg/kg	<0.0052 U	<0.003 U	<0.0045 U	<0.0055 U	<0.0053 U	<0.0044 U	<0.0058 U	<0.0046 U	<0.0058 U	<0.0028 U
1,2-Dibromoethane (Ethylene Dibromide)	106-93-4	NS	NS	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
1,2-Dichlorobenzene	95-50-1	1.1	100	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
1,2-Dichloroethane	107-06-2	0.02	3.1	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
1,2-Dichloropropane	78-87-5	NS	NS	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
1,3,5-Trimethylbenzene (Mesitylene)	108-67-8	8.4	52	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
1,3-Dichlorobenzene	541-73-1	2.4	49	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
1,3-Dichloropropane	142-28-9	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
1,4-Dichlorobenzene	106-46-7	1.8	13	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
1,4-Diethyl Benzene	105-05-5	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
1,4-Dioxane (P-Dioxane)	123-91-1	0.1	13	mg/kg	<0.14 U	<0.08 U	<0.12 U	<0.15 U	<0.14 U	<0.12 U	<0.15 U	<0.12 U	<0.16 U	<0.074 U
2,2-Dichloropropane	594-20-7	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
2-Chlorotoluene	95-49-8	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
2-Hexanone (MBK)	591-78-6	NS	NS	mg/kg	<0.017 U	<0.01 U	<0.015 U	<0.018 U	<0.018 U	<0.015 U	<0.019 U	<0.015 U	<0.02 U	<0.0093 U
4-Chlorotoluene	106-43-4	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
4-Ethyltoluene	622-96-8	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
Acetone	67-64-1	0.05	100	mg/kg	<0.017 U	<0.01 U	<0.015 U	<0.018 U	<0.018 U	<0.015 U	<0.019 U	<0.015 U	<0.02 U	0.0093
Acrylonitrile	107-13-1	NS	NS	mg/kg	<0.0069 U	<0.004 U	<0.006 U	<0.0074 U	<0.007 U	<0.0058 U	<0.0077 U	<0.0061 U	<0.0078 U	<0.0037 U
Benzene	71-43-2	0.06	4.8	mg/kg	<0.00086 U	<0.0005 U	<0.00074 U	<0.00092 U	<0.00088 U	<0.00073 U	<0.00096 U	<0.00076 U	<0.00098 U	<0.00046 U
Bromobenzene	108-86-1	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
Bromochloromethane	74-97-5	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
Bromodichloromethane	75-27-4	NS	NS	mg/kg	<0.00086 U	<0.0005 U	<0.00074 U	<0.00092 U	<0.00088 U	<0.00073 U	<0.00096 U	<0.00076 U	<0.00098 U	<0.00046 U
Bromoform	75-25-2	NS	NS	mg/kg	<0.0069 U	<0.004 U	<0.006 U	<0.0074 U	<0.007 U	<0.0058 U	<0.0077 U	<0.0061 U	<0.0078 U	<0.0037 U
Bromomethane	74-83-9	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
Carbon Disulfide	75-15-0	NS	NS	mg/kg	<0.017 U	<0.01 U	<0.015 U	<0.018 U	<0.018 U	<0.015 U	<0.019 U	<0.015 U	<0.02 U	<0.0093 U
Carbon Tetrachloride	56-23-5	0.76	2.4	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
Chlorobenzene	108-90-7	1.1	100	mg/kg	<0.00086 U	<0.0005 U	<0.00074 U	<0.00092 U	<0.00088 U	<0.00073 U	<0.00096 U	<0.00076 U	<0.00098 U	<0.00046 U
Chloroethane	75-00-3	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
Chloroform	67-66-3	0.37	49	mg/kg	0.00034 J	0.00028 J	0.00029 J	0.00034 J	<0.0026 U	<0.0022 U	<0.0029 U	<0.0023 U	0.00046 J	<0.0014 U
Chloromethane	74-87-3	NS	NS	mg/kg	<0.0069 U	<0.004 U	<0.006 U	<0.0074 U	<0.007 U	<0.0058 U	<0.0077 U	<0.0061 U	<0.0078 U	<0.0037 U
Cis-1,2-Dichloroethene	156-59-2	0.25	100	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
Cis-1,3-Dichloropropene	10061-01-5	NS	NS	mg/kg	<0.00086 U	<0.0005 U	<0.00074 U	<0.00092 U	<0.00088 U	<0.00073 U	<0.00096 U	<0.00076 U	<0.00098 U	<0.00046 U
Cymene	99-87-6	NS	NS	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
Dibromochloromethane	124-48-1	NS	NS	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
Dibromomethane	74-95-3	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
Dichlorodifluoromethane	75-71-8	NS	NS	mg/kg	<0.017 U	<0.01 U	<0.015 U	<0.018 U	<0.018 U	<0.015 U	<0.019 U	<0.015 U	<0.02 U	<0.0093 U
Diethyl Ether (Ethyl Ether)	60-29-7	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
Ethylbenzene	100-41-4	1	41	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
Hexachlorobutadiene	87-68-3	NS	NS	mg/kg	<0.0069 U	<0.004 U	<0.006 U	<0.0074 U	<0.007 U	<0.0058 U	<0.0077 U	<0.0061 U	<0.0078 U	<0.0037 U
Isopropylbenzene (Cumene)	98-82-8	NS	NS	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
M,P-Xylene	179601-23-1	NS	NS	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
Methyl Ethyl Ketone (2-Butanone)	78-93-3	0.12	100	mg/kg	<0.017 U	<0.01 U	<0.015 U	<0.018 U	<0.018 U	<0.015 U	<0.019 U	<0.015 U	<0.02 U	<0.0093 U
Methyl Isobutyl Ketone (4-Methyl-2-Pentanone)	108-10-1	NS	NS	mg/kg	<0.017 U	<0.01 U	<0.015 U	<0.018 U	<0.018 U	<0.015 U	<0.019 U	<0.015 U	<0.02 U	<0.0093 U
Methylene Chloride	75-09-2	0.05	100	mg/kg	<0.0086 U	<0.005 U	<0.0074 U	<0.0092 U	<0.0088 U	<0.0073 U	<0.0096 U	<0.0076 U	<0.0098 U	<0.0046 U
Naphthalene	91-20-3	12	100	mg/kg	<0.0069 U	<0.004 U	<0.006 U	<0.0074 U	<0.007 U	<0.0058 U	<0.0077 U	<0.0061 U	<0.0078 U	<0.0037 U
n-Butylbenzene	104-51-8	12	100	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
n-Propylbenzene	103-65-1	3.9	100	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
o-Xylene (1,2-Dimethylbenzene)	95-47-6	NS	NS	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
Sec-Butylbenzene	135-98-8	11	100	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
Styrene	100-42-5	NS	NS	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
T-Butylbenzene	98-06-6	5.9	100	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
Tert-Butyl Methyl Ether (MTBE)	1634-04-4	0.93	100	mg/kg	<0.0034 U	<0.002 U	<0.003 U	<0.0037 U	<0.0035 U	<0.0029 U	<0.0038 U	<0.003 U	<0.0039 U	<0.0018 U
Tetrachloroethene (PCE)	127-18-4	1.3	19	mg/kg	<0.00086 U	<0.0005 U	<0.00074 U	<0.00092 U	<0.00088 U	<0.00073 U	<0.00096 U	<0.00076 U	<0.00098 U	<0.00046 U
Toluene	108-88-3	0.7	100	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
Total 1,2-Dichloroethene (Cis and Trans)	540-59-0	NS	NS	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
Total Xylenes	1330-20-7	0.26	100	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
Total, 1,3-Dichloropropene (Cis And Trans)	542-75-6	NS	NS	mg/kg	<0.00086 U	<0.0005 U	<0.00074 U	<0.00092 U	<0.00088 U	<0.00073 U	<0.00096 U	<0.00076 U	<0.00098 U	<0.00046 U
Trans-1,2-Dichloroethene	156-60-5	0.19	100	mg/kg	<0.0026 U	<0.0015 U	<0.0022 U	<0.0028 U	<0.0026 U	<0.0022 U	<0.0029 U	<0.0023 U	<0.0029 U	<0.0014 U
Trans-1,3-Dichloropropene	10061-02-6	NS	NS	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U
Trans-1,4-Dichloro-2-Butene	110-57-6	NS	NS	mg/kg	<0.0086 U	<0.005 U	<0.0074 U	<0.0092 U	<0.0088 U	<0.0073 U	<0.0096 U	<0.0076 U	<0.0098 U	<0.0046 U
Trichloroethene (TCE)	79-01-6	0.47	21	mg/kg	<0.00086 U	<0.0005 U	<0.00074 U	<0.00092 U	<0.00088 U	<0.00073 U	<0.00096 U	<0.00076 U	<0.00098 U	<0.00046 U
Trichlorofluoromethane	75-69-4	NS	NS	mg/kg	<0.0069 U	<0.004 U	<0.006 U	<0.0074 U	<0.007 U	<0.0058 U	<0.0077 U	<0.0061 U	<0.0078 U	<0.0037 U
Vinyl Acetate	108-05-4	NS	NS	mg/kg	<0.017 U	<0.01 U	<0.015 U	<0.018 U	<0.018 U	<0.015 U	<0.019 U	<0.015 U	<0.02 U	<0.0093 U
Vinyl Chloride	75-01-4	0.02	0.9	mg/kg	<0.0017 U	<0.001 U	<0.0015 U	<0.0018 U	<0.0018 U	<0.0015 U	<0.0019 U	<0.0015 U	<0.002 U	<0.00093 U

Table 2
Phase II Environmental Site Assessment Report
Soil Sample Analytical Results

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

Analyte	CAS Number	NYSDEC Part 375 Unrestricted Use SCOs	NYSDEC Part 375 Restricted Use Restricted-Residential SCOs	Location	P6SB01	P6SB01	P6SB02	P6SB02	P6SB03	P6SB03	P6SB04	P6SB04	P6SB05	P6SB05
				Sample Name	P6SB01_0-1	P6SB01_5-6	P6SB02_1-2	P6SB02_3-4	P6SB03_1-2	P6SB03_4-5	P6SB04_0-1	P6SB04_4-5	P6SB05_1-2	P6SB05_5-6
				Sample Date	10/16/2025	10/16/2025	10/16/2025	10/16/2025	10/15/2025	10/15/2025	10/15/2025	10/15/2025	10/16/2025	10/16/2025
				Sample Depth	0-1	5-6	1-2	3-4	1-2	4-5	0-1	4-5	1-2	5-6
				Unit	Result	Result	Result	Result	Result	Result	Result	Result	Result	Result
Semi-Volatile Organic Compounds														
1,2,4,5-Tetrachlorobenzene	95-94-3	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
1,2,4-Trichlorobenzene	120-82-1	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
1,2-Dichlorobenzene	95-50-1	1.1	100	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
1,3-Dichlorobenzene	541-73-1	2.4	49	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
1,4-Dichlorobenzene	106-46-7	1.8	13	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
1,4-Dioxane (P-Dioxane)	123-91-1	0.1	13	mg/kg	<0.26 U	<0.029 U	<0.032 U	<0.03 U	<0.029 U	<0.028 U	<0.03 U	<0.032 U	<0.026 U	<0.029 U
2,4,5-Trichlorophenol	95-95-4	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
2,4,6-Trichlorophenol	88-06-2	NS	NS	mg/kg	<1 U	<0.12 U	<0.13 U	<0.12 U	<0.11 U	<0.11 U	<0.12 U	<0.13 U	<0.1 U	<0.12 U
2,4-Dichlorophenol	120-83-2	NS	NS	mg/kg	<1.5 U	<0.17 U	<0.19 U	<0.18 U	<0.17 U	<0.17 U	<0.18 U	<0.19 U	<0.16 U	<0.17 U
2,4-Dimethylphenol	105-67-9	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
2,4-Dinitrophenol	51-28-5	NS	NS	mg/kg	<8.2 U	<0.92 U	<1 U	<0.96 U	<0.92 U	<0.89 U	<0.96 U	<1 U	<0.84 U	<0.93 U
2,4-Dinitrotoluene	121-14-2	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
2,6-Dinitrotoluene	606-20-2	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
2-Chloronaphthalene	91-58-7	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
2-Chlorophenol	95-57-8	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
2-Methylnaphthalene	91-57-6	NS	NS	mg/kg	3.3	<0.23 U	0.2 J	<0.24 U	<0.23 U	0.091 J	0.042 J	<0.26 U	0.17 J	<0.23 U
2-Methylphenol (o-Cresol)	95-48-7	0.33	100	mg/kg	<1.7 U	<0.19 U	0.057 J	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
2-Nitroaniline	88-74-4	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
2-Nitrophenol	88-75-5	NS	NS	mg/kg	<3.7 U	<0.42 U	<0.47 U	<0.43 U	<0.41 U	<0.4 U	<0.43 U	<0.46 U	<0.38 U	<0.42 U
3 & 4 Methylphenol (m&p Cresol)	65794-96-9	0.33	100	mg/kg	<2.5 U	<0.28 U	0.26 J	<0.29 U	<0.28 U	<0.27 U	<0.29 U	<0.31 U	<0.25 U	<0.28 U
3,3'-Dichlorobenzidine	91-94-1	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
3-Nitroaniline	99-09-2	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
4,6-Dinitro-2-Methylphenol	534-52-1	NS	NS	mg/kg	<4.5 U	<0.5 U	<0.56 U	<0.52 U	<0.5 U	<0.48 U	<0.52 U	<0.56 U	<0.46 U	<0.5 U
4-Bromophenyl Phenyl Ether	101-55-3	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
4-Chloro-3-Methylphenol	59-50-7	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
4-Chloroaniline	106-47-8	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
4-Chlorophenyl Phenyl Ether	7005-72-3	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
4-Nitroaniline	100-01-6	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
4-Nitrophenol	100-02-7	NS	NS	mg/kg	<2.4 U	<0.27 U	<0.3 U	<0.28 U	<0.27 U	<0.26 U	<0.28 U	<0.3 U	<0.25 U	<0.27 U
Acenaphthene	83-32-9	20	100	mg/kg	17	<0.15 U	0.3	<0.16 U	<0.15 U	0.019 J	0.038 J	<0.17 U	0.59	<0.15 U
Acenaphthylene	208-96-8	100	100	mg/kg	0.31 J	0.041 J	2	0.055 J	<0.15 U	<0.15 U	0.056 J	<0.17 U	0.17	0.051 J
Acetophenone	98-86-2	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	0.038 J	<0.19 U
Anthracene	120-12-7	100	100	mg/kg	38	<0.12 U	3.7	0.047 J	0.06 J	<0.11 U	0.14	0.05 J	1	<0.12 U
Benzo(a)anthracene	56-55-3	**1**	1	mg/kg	**56**	0.092 J	**14**	0.14	0.23	<0.11 U	0.66	0.24	**2**	0.047 J
Benzo(a)pyrene	50-32-8	**1**	1	mg/kg	**49**	<0.15 U	**12**	0.12 J	0.23	<0.15 U	0.69	0.3	**2.3**	0.056 J
Benzo(b)fluoranthene	205-99-2	**1**	1	mg/kg	**65**	0.045 J	**15**	0.14	0.31	<0.11 U	0.88	0.38	**2.6**	0.047 J
Benzo(g,h,i)Perylene	191-24-2	100	100	mg/kg	31	<0.15 U	3.6	0.053 J	0.15	<0.15 U	0.45	0.16 J	2	0.35
Benzo(k)fluoranthene	207-08-9	**0.8**	3.9	mg/kg	**16**	<0.12 U	**5.5**	0.052 J	0.11	<0.11 U	0.28	0.094 J	**0.94**	<0.12 U
Benzoic Acid	65-85-0	NS	NS	mg/kg	<5.6 U	<0.62 U	<0.7 U	<0.65 U	<0.62 U	<0.6 U	<0.65 U	<0.7 U	<0.57 U	<0.63 U
Benzyl Alcohol	100-51-6	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
Benzyl Butyl Phthalate	85-68-7	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
Biphenyl (Diphenyl)	92-52-4	NS	NS	mg/kg	1.4 J	<0.44 U	0.044 J	<0.46 U	<0.44 U	<0.42 U	<0.46 U	<0.49 U	0.053 J	<0.44 U
Bis(2-chloroethoxy) methane	111-91-1	NS	NS	mg/kg	<1.8 U	<0.21 U	<0.23 U	<0.22 U	<0.21 U	<0.2 U	<0.22 U	<0.23 U	<0.19 U	<0.21 U
Bis(2-chloroethyl) ether (2-chloroethyl ether)	111-44-4	NS	NS	mg/kg	<1.5 U	<0.17 U	<0.19 U	<0.18 U	<0.17 U	<0.17 U	<0.18 U	<0.19 U	<0.16 U	<0.17 U
Bis(2-chloroisopropyl) ether	108-60-1	NS	NS	mg/kg	<2.1 U	<0.23 U	<0.26 U	<0.24 U	<0.23 U	<0.22 U	<0.24 U	<0.26 U	<0.21 U	<0.23 U
Bis(2-ethylhexyl) phthalate	117-81-7	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	0.17 J	<0.18 U	0.18 J	<0.22 U	<0.18 U	<0.19 U
Carbazole	86-74-8	NS	NS	mg/kg	18	0.024 J	0.93	<0.2 U	0.027 J	<0.18 U	0.083 J	0.027 J	0.32	<0.19 U
Chrysene	218-01-9	**1**	3.9	mg/kg	**48**	0.07 J	**11**	0.12	0.23	<0.11 U	0.68	0.25	**1.8**	0.035 J
Dibenz(a,h)anthracene	53-70-3	**0.33**	0.33	mg/kg	**6.2**	<0.12 U	**1.8**	<0.12 U	0.043 J	<0.11 U	0.11 J	0.042 J	**0.65**	0.042 J
Dibenzofuran	132-64-9	**7**	59	mg/kg	**12**	<0.19 U	0.28	<0.2 U	<0.19 U	<0.18 U	0.039 J	<0.22 U	0.28	<0.19 U
Dibutyl phthalate	84-74-2	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
Diethyl phthalate	84-66-2	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
Dimethyl phthalate	131-11-3	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
Dioctyl phthalate	117-84-0	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
Fluoranthene	206-44-0	**100**	100	mg/kg	**120**	0.12	23	0.22	0.44	<0.11 U	1.5	0.42	4.2	0.065 J
Fluorene	86-73-7	30	100	mg/kg	18	0.033 J	0.55	<0.2 U	0.018 J	<0.18 U	0.049 J	<0.22 U	0.46	<0.19 U
Hexachlorobenzene	118-74-1	0.33	1.2	mg/kg	<1 U	<0.12 U	<0.13 U	<0.12 U	<0.11 U	<0.11 U	<0.12 U	<0.13 U	<0.1 U	<0.12 U
Hexachlorobutadiene	87-68-3	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
Hexachlorocyclopentadiene	77-47-4	NS	NS	mg/kg	<4.9 U	<0.55 U	<0.62 U	<0.57 U	<0.55 U	<0.53 U	<0.57 U	<0.62 U	<0.5 U	<0.55 U
Hexachloroethane	67-72-1	NS	NS	mg/kg	<1.4 U	<0.15 U	<0.17 U	<0.16 U	<0.15 U	<0.15 U	<0.16 U	<0.17 U	<0.14 U	<0.15 U
Indeno(1,2,3-cd)pyrene	193-39-5	**0.5**	0.5	mg/kg	**32**	<0.15 U	**4.1**	0.06 J	0.13 J	<0.15 U	0.38	0.15 J	**1.6**	0.19
Isophorone	78-59-1	NS	NS	mg/kg	<1.5 U	<0.17 U	<0.19 U	<0.18 U	<0.17 U	<0.17 U	<0.18 U	<0.19 U	<0.16 U	<0.17 U
Naphthalene	91-20-3	12	100	mg/kg	12	0.026 J	0.46	<0.2 U	0.024 J	0.12 J	0.053 J	0.034 J	0.25	<0.19 U
Nitrobenzene	98-95-3	NS	NS	mg/kg	<1.5 U	<0.17 U	<0.19 U	<0.18 U	<0.17 U	<0.17 U	<0.18 U	<0.19 U	<0.16 U	<0.17 U
n-Nitrosodi-N-Propylamine	621-64-7	NS	NS	mg/kg	<1.7 U	<0.19 U	<0.22 U	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
n-Nitrosodiphenylamine	86-30-6	NS	NS	mg/kg	<1.4 U	<0.15 U	<0.17 U	<0.16 U	<0.15 U	<0.15 U	<0.16 U	<0.17 U	<0.14 U	<0.15 U
Pentachlorophenol	87-86-5	0.8	6.7	mg/kg	<1.4 U	<0.15 U	<0.17 U	<0.16 U	<0.15 U	<0.15 U	<0.16 U	<0.17 U	<0.14 U	<0.15 U
Phenanthrene	85-01-8	**100**	100	mg/kg	**120**	0.077 J	6	0.042 J	0.23	<0.11 U	0.71	0.22	3.7	0.062 J
Phenol	108-95-2	0.33	100	mg/kg	<1.7 U	<0.19 U	0.082 J	<0.2 U	<0.19 U	<0.18 U	<0.2 U	<0.22 U	<0.18 U	<0.19 U
Pyrene	129-00-0	100	100	mg/kg	94	0.12	19	0.21	0.37	<0.11 U	1.2	0.38	3.7	0.054 J

Table 2
Phase II Environmental Site Assessment Report
Soil Sample Analytical Results

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

Analyte	CAS Number	NYSDEC Part 375 Unrestricted Use SCOs	NYSDEC Part 375 Restricted Use Restricted-Residential SCOs	Location	P6SB01	P6SB01	P6SB02	P6SB02	P6SB03	P6SB03	P6SB04	P6SB04	P6SB05	P6SB05
				Sample Name	P6SB01_0-1	P6SB01_5-6	P6SB02_1-2	P6SB02_3-4	P6SB03_1-2	P6SB03_4-5	P6SB04_0-1	P6SB04_4-5	P6SB05_1-2	P6SB05_5-6
				Sample Date	10/16/2025	10/16/2025	10/16/2025	10/16/2025	10/15/2025	10/15/2025	10/15/2025	10/15/2025	10/16/2025	10/16/2025
				Sample Depth	0-1	5-6	1-2	3-4	1-2	4-5	0-1	4-5	1-2	5-6
				Unit	Result	Result	Result	Result	Result	Result	Result	Result	Result	Result
Pesticides														
4,4'-DDD	72-54-8	**0.0033**	13	mg/kg	<0.00158 U	NA	<0.00197 U	NA	<0.00183 U	NA	<0.00189 U	NA	<0.00169 U	NA
4,4'-DDE	72-55-9	**0.0033**	8.9	mg/kg	**0.0156**	NA	<0.00197 U	NA	**0.00723**	NA	**0.0151**	NA	0.00224	NA
4,4'-DDT	50-29-3	**0.0033**	7.9	mg/kg	**0.012**	NA	<0.00197 U	NA	**0.00434**	NA	**0.0106**	NA	0.00252	NA
Aldrin	309-00-2	0.005	0.097	mg/kg	<0.00158 U	NA	<0.00197 U	NA	<0.00183 U	NA	<0.00189 U	NA	<0.00169 U	NA
Alpha BHC (Alpha Hexachlorocyclohexane)	319-84-6	0.02	0.48	mg/kg	<0.00066 U	NA	<0.000822 U	NA	<0.000763 U	NA	<0.000788 U	NA	<0.000704 U	NA
Alpha Chlordane	5103-71-9	0.094	4.2	mg/kg	0.015 IP	NA	<0.00247 U	NA	<0.00229 U	NA	<0.00236 U	NA	<0.00211 U	NA
Alpha Endosulfan	959-98-8	2.4	24	mg/kg	<0.00158 U	NA	<0.00197 U	NA	<0.00183 U	NA	<0.00189 U	NA	<0.00169 U	NA
Beta Bhc (Beta Hexachlorocyclohexane)	319-85-7	0.036	0.36	mg/kg	<0.00158 U	NA	<0.00197 U	NA	<0.00183 U	NA	<0.00189 U	NA	<0.00169 U	NA
Beta Endosulfan	33213-65-9	2.4	24	mg/kg	<0.00158 U	NA	<0.00197 U	NA	<0.00183 U	NA	<0.00189 U	NA	<0.00169 U	NA
Chlordane (alpha and gamma)	57-74-9	NS	NS	mg/kg	0.0875	NA	<0.0164 U	NA	<0.0153 U	NA	<0.0158 U	NA	<0.0141 U	NA
Delta Bhc (Delta Hexachlorocyclohexane)	319-86-8	0.04	100	mg/kg	<0.00158 U	NA	<0.00197 U	NA	<0.00183 U	NA	<0.00189 U	NA	<0.00169 U	NA
Dieldrin	60-57-1	**0.005**	0.2	mg/kg	**0.00579**	NA	<0.00123 U	NA	<0.00114 U	NA	<0.00118 U	NA	<0.00106 U	NA
Endosulfan Sulfate	1031-07-8	2.4	24	mg/kg	<0.00066 U	NA	<0.000822 U	NA	<0.000763 U	NA	<0.000788 U	NA	<0.000704 U	NA
Endrin	72-20-8	0.014	11	mg/kg	<0.00066 U	NA	<0.000822 U	NA	<0.000763 U	NA	<0.000788 U	NA	<0.000704 U	NA
Endrin Aldehyde	7421-93-4	NS	NS	mg/kg	<0.00198 U	NA	<0.00247 U	NA	<0.00229 U	NA	<0.00236 U	NA	<0.00211 U	NA
Endrin Ketone	53494-70-5	NS	NS	mg/kg	<0.00158 U	NA	<0.00197 U	NA	<0.00183 U	NA	<0.00189 U	NA	<0.00169 U	NA
Gamma Bhc (Lindane)	58-89-9	0.1	1.3	mg/kg	<0.00066 U	NA	<0.000822 U	NA	<0.000763 U	NA	<0.000788 U	NA	<0.000704 U	NA
Gamma Chlordane (Trans)	5103-74-2	NS	NS	mg/kg	0.00758	NA	<0.00247 U	NA	0.000655 J	NA	<0.00236 U	NA	<0.00211 U	NA
Heptachlor	76-44-8	0.042	2.1	mg/kg	<0.000792 U	NA	<0.000986 U	NA	<0.000916 U	NA	<0.000946 U	NA	<0.000844 U	NA
Heptachlor Epoxide	1024-57-3	NS	NS	mg/kg	0.00419	NA	<0.0037 U	NA	<0.00344 U	NA	<0.00355 U	NA	<0.00317 U	NA
Methoxychlor	72-43-5	NS	NS	mg/kg	<0.00297 U	NA	<0.0037 U	NA	<0.00344 U	NA	<0.00355 U	NA	<0.00317 U	NA
Toxaphene	8001-35-2	NS	NS	mg/kg	<0.0297 U	NA	<0.037 U	NA	<0.0344 U	NA	<0.0355 U	NA	<0.0317 U	NA
Herbicides														
2,4,5-T (Trichlorophenoxyacetic Acid)	93-76-5	NS	NS	mg/kg	<0.173 U	NA	<0.215 U	NA	<0.193 U	NA	<0.199 U	NA	<0.18 U	NA
2,4-D (Dichlorophenoxyacetic Acid)	94-75-7	NS	NS	mg/kg	<0.173 U	NA	<0.215 U	NA	<0.193 U	NA	<0.199 U	NA	<0.18 U	NA
Silvex (2,4,5-Tp)	93-72-1	3.8	100	mg/kg	<0.173 U	NA	<0.215 U	NA	<0.193 U	NA	<0.199 U	NA	<0.18 U	NA
Polychlorinated Biphenyl														
PCB-1016 (Aroclor 1016)	12674-11-2	NS	NS	mg/kg	<0.0485 U	<0.0582 U	<0.0641 U	<0.0597 U	<0.0551 U	<0.0536 U	<0.0562 U	<0.065 U	<0.0523 U	<0.0561 U
PCB-1221 (Aroclor 1221)	11104-28-2	NS	NS	mg/kg	<0.0485 U	<0.0582 U	<0.0641 U	<0.0597 U	<0.0551 U	<0.0536 U	<0.0562 U	<0.065 U	<0.0523 U	<0.0561 U
PCB-1232 (Aroclor 1232)	11141-16-5	NS	NS	mg/kg	<0.0485 U	<0.0582 U	<0.0641 U	<0.0597 U	<0.0551 U	<0.0536 U	<0.0562 U	<0.065 U	<0.0523 U	<0.0561 U
PCB-1242 (Aroclor 1242)	53469-21-9	NS	NS	mg/kg	<0.0485 U	<0.0582 U	<0.0641 U	<0.0597 U	<0.0551 U	<0.0536 U	<0.0562 U	<0.065 U	<0.0523 U	<0.0561 U
PCB-1248 (Aroclor 1248)	12672-29-6	NS	NS	mg/kg	<0.0485 U	<0.0582 U	<0.0641 U	<0.0597 U	<0.0551 U	<0.0536 U	<0.0562 U	<0.065 U	<0.0523 U	<0.0561 U
PCB-1254 (Aroclor 1254)	11097-69-1	NS	NS	mg/kg	<0.0485 U	<0.0582 U	0.0166 JIP	<0.0597 U	<0.0551 U	<0.0536 U	<0.0562 U	<0.065 U	<0.0523 U	<0.0561 U
PCB-1260 (Aroclor 1260)	11096-82-5	NS	NS	mg/kg	<0.0485 U	<0.0582 U	0.022 J	<0.0597 U	<0.0551 U	<0.0536 U	0.0158 J	<0.065 U	<0.0523 U	<0.0561 U
PCB-1262 (Aroclor 1262)	37324-23-5	NS	NS	mg/kg	<0.0485 U	<0.0582 U	<0.0641 U	<0.0597 U	<0.0551 U	<0.0536 U	<0.0562 U	<0.065 U	<0.0523 U	<0.0561 U
PCB-1268 (Aroclor 1268)	11100-14-4	NS	NS	mg/kg	<0.0485 U	<0.0582 U	<0.0641 U	<0.0597 U	<0.0551 U	<0.0536 U	0.00698 J	<0.065 U	<0.0523 U	<0.0561 U
Total PCBs	1336-36-3	0.1	1	mg/kg	<0.0485 U	<0.0582 U	0.0386 J	<0.0597 U	<0.0551 U	<0.0536 U	0.0228 J	<0.065 U	<0.0523 U	<0.0561 U
Metals														
Aluminum	7429-90-5	NS	NS	mg/kg	7,010	11,700	9,700	14,300	7,300	10,900	7,540	13,300	5,940	8,770
Antimony	7440-36-0	NS	NS	mg/kg	<4.01 U	<4.61 U	<12.4 U	<4.61 U	<4.65 U	<4.48 U	<4.59 U	<5.11 U	<4.29 U	<4.56 U
Arsenic	7440-38-2	13	16	mg/kg	4.22	1.01	9.68	3.44	6.88	2.52	6.19	4.08	7.53	3.04
Barium	7440-39-3	**350**	400	mg/kg	91.8	110	102	58.9	139	41.4	241	132	**587**	73.7
Beryllium	7440-41-7	7.2	72	mg/kg	0.342 J	0.419 J	0.387 J	0.674	0.455 J	0.49	0.52	0.646	0.344 J	0.346 J
Cadmium	7440-43-9	2.5	4.3	mg/kg	0.319 J	0.124 J	0.345 J	0.122 J	0.805 J	<0.896 U	0.609 J	0.194 J	0.769 J	0.18 J
Calcium	7440-70-2	NS	NS	mg/kg	76,600	32,500	80,600	11,200	55,000	27,800	61,400	29,100	65,700	81,300
Chromium, Hexavalent	18540-29-9	1	110	mg/kg	<0.841 U	<0.948 U	<1.04 U	<0.978 U	<0.941 U	<0.914 U	<0.963 U	<1.06 U	<0.871 U	<0.954 U
Chromium, Total	7440-47-3	NS	NS	mg/kg	10.3	15.7	20.8	20.8	13.4	16.1	14.4	19.2	14.5	12
Chromium, Trivalent	16065-83-1	30	180	mg/kg	10.3	15.7	20.8	20.8	13.4	16.1	14.4	19.2	14.5	12
Cobalt	7440-48-4	NS	NS	mg/kg	6.68	9.02	15.2	13.1	7.54	9.12	7.05	9.3	8.33	8.41
Copper	7440-50-8	**50**	270	mg/kg	24	21	**60.4**	22.6	**56.1**	16.5	48.6	28.2	**198**	21.4
Cyanide	57-12-5	27	27	mg/kg	0.22 J	<1.1 U	<1.2 U	<1.1 U	<1.1 U	<1.1 U	<1.2 U	<1.3 U	<1 U	<1.2 U
Iron	7439-89-6	NS	NS	mg/kg	15,600	17,300	63,000	23,200	14,900	18,200	16,400	19,800	19,700	15,600
Lead	7439-92-1	**63**	400	mg/kg	49.8	8.48	23.8	17.2	**275**	13.6	**153**	**130**	**1,600**	22.5
Magnesium	7439-95-4	NS	NS	mg/kg	11,800	16,300	19,000	8,520	15,900	17,400	14,100	12,500	12,000	15,200
Manganese	7439-96-5	1600	2000	mg/kg	368	203	624	204	382	251	488	460	333	268
Mercury	7439-97-6	**0.18**	0.81	mg/kg	0.081 J	<0.093 U	<0.085 U	<0.096 U	**1.01**	<0.073 U	**0.354**	**0.311**	**0.868**	<0.082 U
Nickel	7440-02-0	**30**	310	mg/kg	19.6	25	**50.7**	**33.5**	21.2	24.8	**34.3**	29.2	19.6	20.8
Potassium	7440-09-7	NS	NS	mg/kg	840	815	1,040	829	745	814	823	962	633	705
Selenium	7782-49-2	3.9	180	mg/kg	<1.6 U	<1.84 U	<4.95 U	<1.84 U	0.317 J	<1.79 U	0.374 J	<2.04 U	<1.72 U	<1.82 U
Silver	7440-22-4	2	180	mg/kg	<0.401 U	<0.461 U	<1.24 U	<0.461 U	0.387 J	<0.448 U	0.297 J	<0.511 U	<0.429 U	<0.456 U
Sodium	7440-23-5	NS	NS	mg/kg	90.1 J	<184 U	354 J	397	<186 U	<179 U	<183 U	<204 U	147 J	310
Thallium	7440-28-0	NS	NS	mg/kg	<1.6 U	<1.84 U	<4.95 U	<1.84 U	<1.86 U	<1.79 U	<1.83 U	<2.04 U	<1.72 U	<1.82 U
Vanadium	7440-62-2	NS	NS	mg/kg	15.4	18.1	20.2	28.8	18.4	18.2	20	19.9	15.8	15
Zinc	7440-66-6	**109**	10000	mg/kg	68.8	51.4	61.1	65.9	**202**	53.9	**112**	95.4	**653**	48.9
General Chemistry														
Solids, Percent	SOLID	NS	NS	Percent	95.1	84.4	76.8	81.8	85	87.5	83.1	75.5	91.8	83.9

Table 2
Phase II Environmental Site Assessment Report
Soil Sample Analytical Results

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

Analyte	CAS Number	NYSDEC Part 375 Unrestricted Use SCOs	NYSDEC Part 375 Restricted Use Restricted-Residential SCOs	Location	P6SB06	P6SB06	P6SB07	P6SB07	P6SB08	P6SB08	P6SB09	P6SB09	P6SB10	P6SB10
				Sample Name	P6SB06_0-1	P6SB06_3-4	P6SB07_1-2	P6SB07_2-3	P6SB08_0-1	P6SB08_2-3	P6SB09_1-2	P6SB09_3-4	P6SB10_0-1	P6SB10_2-3
				Sample Date	10/15/2025	10/15/2025	10/15/2025	10/15/2025	10/16/2025	10/16/2025	10/16/2025	10/16/2025	10/15/2025	10/15/2025
				Sample Depth	0-1	3-4	1-2	2-3	0-1	2-3	1-2	3-4	0-1	2-3
				Unit	Result	Result	Result	Result	Result	Result	Result	Result	Result	Result
Volatile Organic Compounds														
1,1,1,2-Tetrachloroethane	630-20-6	NS	NS	mg/kg	<0.00084 U	<0.0009 U	<0.00076 U	<0.00093 U	<0.00072 U	<0.0012 U	<0.001 U	<0.0008 U	<0.00069 U	<0.00058 U
1,1,1-Trichloroethane	71-55-6	0.68	100	mg/kg	<0.00084 U	<0.0009 U	<0.00076 U	<0.00093 U	<0.00072 U	<0.0012 U	<0.001 U	<0.0008 U	<0.00069 U	<0.00058 U
1,1,2,2-Tetrachloroethane	79-34-5	NS	NS	mg/kg	<0.00084 U	<0.0009 U	<0.00076 U	<0.00093 U	<0.00072 U	<0.0012 U	<0.001 U	<0.0008 U	<0.00069 U	<0.00058 U
1,1,2-Trichloroethane	79-00-5	NS	NS	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
1,1-Dichloroethane	75-34-3	0.27	26	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
1,1-Dichloroethene	75-35-4	0.33	100	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
1,1-Dichloropropene	563-58-6	NS	NS	mg/kg	<0.00084 U	<0.0009 U	<0.00076 U	<0.00093 U	<0.00072 U	<0.0012 U	<0.001 U	<0.0008 U	<0.00069 U	<0.00058 U
1,2,3-Trichlorobenzene	87-61-6	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
1,2,3-Trichloropropane	96-18-4	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
1,2,4,5-Tetramethylbenzene	95-93-2	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
1,2,4-Trichlorobenzene	120-82-1	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
1,2,4-Trimethylbenzene	95-63-6	3.6	52	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
1,2-Dibromo-3-Chloropropane	96-12-8	NS	NS	mg/kg	<0.005 U	<0.0054 U	<0.0045 U	<0.0056 U	<0.0044 U	<0.0074 U	<0.006 U	<0.0048 U	<0.0041 U	<0.0034 U
1,2-Dibromoethane (Ethylene Dibromide)	106-93-4	NS	NS	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
1,2-Dichlorobenzene	95-50-1	1.1	100	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
1,2-Dichloroethane	107-06-2	0.02	3.1	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
1,2-Dichloropropane	78-87-5	NS	NS	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
1,3,5-Trimethylbenzene (Mesitylene)	108-67-8	8.4	52	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
1,3-Dichlorobenzene	541-73-1	2.4	49	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
1,3-Dichloropropane	142-28-9	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
1,4-Dichlorobenzene	106-46-7	1.8	13	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
1,4-Diethyl Benzene	105-05-5	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
1,4-Dioxane (P-Dioxane)	123-91-1	0.1	13	mg/kg	<0.13 U	<0.14 U	<0.12 U	<0.15 U	<0.12 U	<0.2 U	<0.16 U	<0.13 U	<0.11 U	<0.092 U
2,2-Dichloropropane	594-20-7	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
2-Chlorotoluene	95-49-8	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
2-Hexanone (MBK)	591-78-6	NS	NS	mg/kg	<0.017 U	<0.018 U	<0.015 U	<0.018 U	<0.014 U	<0.025 U	<0.02 U	<0.016 U	<0.014 U	<0.012 U
4-Chlorotoluene	106-43-4	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
4-Ethyltoluene	622-96-8	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
Acetone	67-64-1	0.05	100	mg/kg	<0.017 U	<0.018 U	<0.015 U	<0.018 U	<0.014 U	<0.025 U	<0.02 U	<0.016 U	<0.014 U	<0.012 U
Acrylonitrile	107-13-1	NS	NS	mg/kg	<0.0067 U	<0.0072 U	<0.006 U	<0.0074 U	<0.0058 U	<0.0099 U	<0.008 U	<0.0064 U	<0.0055 U	<0.0046 U
Benzene	71-43-2	0.06	4.8	mg/kg	<0.00084 U	<0.0009 U	<0.00076 U	<0.00093 U	<0.00072 U	<0.0012 U	<0.001 U	<0.0008 U	<0.00069 U	<0.00058 U
Bromobenzene	108-86-1	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
Bromochloromethane	74-97-5	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
Bromodichloromethane	75-27-4	NS	NS	mg/kg	<0.00084 U	<0.0009 U	<0.00076 U	<0.00093 U	<0.00072 U	<0.0012 U	<0.001 U	<0.0008 U	<0.00069 U	<0.00058 U
Bromoform	75-25-2	NS	NS	mg/kg	<0.0067 U	<0.0072 U	<0.006 U	<0.0074 U	<0.0058 U	<0.0099 U	<0.008 U	<0.0064 U	<0.0055 U	<0.0046 U
Bromomethane	74-83-9	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
Carbon Disulfide	75-15-0	NS	NS	mg/kg	<0.017 U	<0.018 U	<0.015 U	<0.018 U	<0.014 U	<0.025 U	<0.02 U	<0.016 U	<0.014 U	<0.012 U
Carbon Tetrachloride	56-23-5	0.76	2.4	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
Chlorobenzene	108-90-7	1.1	100	mg/kg	<0.00084 U	<0.0009 U	<0.00076 U	<0.00093 U	<0.00072 U	<0.0012 U	<0.001 U	<0.0008 U	<0.00069 U	<0.00058 U
Chloroethane	75-00-3	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
Chloroform	67-66-3	0.37	49	mg/kg	<0.0025 U	<0.0027 U	0.00042 JB	0.00043 JB	0.00033 J	0.0011 J	0.00036 J	0.00032 J	<0.0021 U	<0.0017 U
Chloromethane	74-87-3	NS	NS	mg/kg	<0.0067 U	<0.0072 U	<0.006 U	<0.0074 U	<0.0058 U	<0.0099 U	<0.008 U	<0.0064 U	<0.0055 U	<0.0046 U
Cis-1,2-Dichloroethene	156-59-2	0.25	100	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
Cis-1,3-Dichloropropene	10061-01-5	NS	NS	mg/kg	<0.00084 U	<0.0009 U	<0.00076 U	<0.00093 U	<0.00072 U	<0.0012 U	<0.001 U	<0.0008 U	<0.00069 U	<0.00058 U
Cymene	99-87-6	NS	NS	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
Dibromochloromethane	124-48-1	NS	NS	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
Dibromomethane	74-95-3	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
Dichlorodifluoromethane	75-71-8	NS	NS	mg/kg	<0.017 U	<0.018 U	<0.015 U	<0.018 U	<0.014 U	<0.025 U	<0.02 U	<0.016 U	<0.014 U	<0.012 U
Diethyl Ether (Ethyl Ether)	60-29-7	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
Ethylbenzene	100-41-4	1	41	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
Hexachlorobutadiene	87-68-3	NS	NS	mg/kg	<0.0067 U	<0.0072 U	<0.006 U	<0.0074 U	<0.0058 U	<0.0099 U	<0.008 U	<0.0064 U	<0.0055 U	<0.0046 U
Isopropylbenzene (Cumene)	98-82-8	NS	NS	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
M,P-Xylene	179601-23-1	NS	NS	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
Methyl Ethyl Ketone (2-Butanone)	78-93-3	0.12	100	mg/kg	<0.017 U	<0.018 U	<0.015 U	<0.018 U	<0.014 U	<0.025 U	<0.02 U	<0.016 U	<0.014 U	<0.012 U
Methyl Isobutyl Ketone (4-Methyl-2-Pentanone)	108-10-1	NS	NS	mg/kg	<0.017 U	<0.018 U	<0.015 U	<0.018 U	<0.014 U	<0.025 U	<0.02 U	<0.016 U	<0.014 U	<0.012 U
Methylene Chloride	75-09-2	0.05	100	mg/kg	<0.0084 U	<0.009 U	<0.0076 U	<0.0093 U	<0.0072 U	<0.012 U	<0.01 U	<0.008 U	<0.0069 U	<0.0058 U
Naphthalene	91-20-3	12	100	mg/kg	<0.0067 U	<0.0072 U	<0.006 U	<0.0074 U	0.0013 J	<0.0099 U	<0.008 U	<0.0064 U	<0.0055 U	<0.0046 U
n-Butylbenzene	104-51-8	12	100	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
n-Propylbenzene	103-65-1	3.9	100	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
o-Xylene (1,2-Dimethylbenzene)	95-47-6	NS	NS	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
Sec-Butylbenzene	135-98-8	11	100	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
Styrene	100-42-5	NS	NS	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
T-Butylbenzene	98-06-6	5.9	100	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
Tert-Butyl Methyl Ether (MTBE)	1634-04-4	0.93	100	mg/kg	<0.0034 U	<0.0036 U	<0.003 U	<0.0037 U	<0.0029 U	<0.005 U	<0.004 U	<0.0032 U	<0.0028 U	<0.0023 U
Tetrachloroethene (PCE)	127-18-4	1.3	19	mg/kg	<0.00084 U	<0.0009 U	0.00079	0.0028	<0.00072 U	<0.0012 U	<0.001 U	<0.0008 U	<0.00069 U	<0.00058 U
Toluene	108-88-3	0.7	100	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
Total 1,2-Dichloroethene (Cis and Trans)	540-59-0	NS	NS	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
Total Xylenes	1330-20-7	0.26	100	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
Total, 1,3-Dichloropropene (Cis And Trans)	542-75-6	NS	NS	mg/kg	<0.00084 U	<0.0009 U	<0.00076 U	<0.00093 U	<0.00072 U	<0.0012 U	<0.001 U	<0.0008 U	<0.00069 U	<0.00058 U
Trans-1,2-Dichloroethene	156-60-5	0.19	100	mg/kg	<0.0025 U	<0.0027 U	<0.0023 U	<0.0028 U	<0.0022 U	<0.0037 U	<0.003 U	<0.0024 U	<0.0021 U	<0.0017 U
Trans-1,3-Dichloropropene	10061-02-6	NS	NS	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U
Trans-1,4-Dichloro-2-Butene	110-57-6	NS	NS	mg/kg	<0.0084 U	<0.009 U	<0.0076 U	<0.0093 U	<0.0072 U	<0.012 U	<0.01 U	<0.008 U	<0.0069 U	<0.0058 U
Trichloroethene (TCE)	79-01-6	0.47	21	mg/kg	<0.00084 U	<0.0009 U	<0.00076 U	<0.00093 U	<0.00072 U	<0.0012 U	<0.001 U	<0.0008 U	<0.00069 U	<0.00058 U
Trichlorofluoromethane	75-69-4	NS	NS	mg/kg	<0.0067 U	<0.0072 U	<0.006 U	<0.0074 U	<0.0058 U	<0.0099 U	<0.008 U	<0.0064 U	<0.0055 U	<0.0046 U
Vinyl Acetate	108-05-4	NS	NS	mg/kg	<0.017 U	<0.018 U	<0.015 U	<0.018 U	<0.014 U	<0.025 U	<0.02 U	<0.016 U	<0.014 U	<0.012 U
Vinyl Chloride	75-01-4	0.02	0.9	mg/kg	<0.0017 U	<0.0018 U	<0.0015 U	<0.0018 U	<0.0014 U	<0.0025 U	<0.002 U	<0.0016 U	<0.0014 U	<0.0012 U

Table 2
Phase II Environmental Site Assessment Report
Soil Sample Analytical Results

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

Analyte	CAS Number	NYSDEC Part 375 Unrestricted Use SCOs	NYSDEC Part 375 Restricted Use Restricted-Residential SCOs	Location	P6SB06	P6SB06	P6SB07	P6SB07	P6SB08	P6SB08	P6SB09	P6SB09	P6SB10	P6SB10
				Sample Name	P6SB06_0-1	P6SB06_3-4	P6SB07_1-2	P6SB07_2-3	P6SB08_0-1	P6SB08_2-3	P6SB09_1-2	P6SB09_3-4	P6SB10_0-1	P6SB10_2-3
				Sample Date	10/15/2025	10/15/2025	10/15/2025	10/15/2025	10/16/2025	10/16/2025	10/16/2025	10/16/2025	10/15/2025	10/15/2025
				Sample Depth	0-1	3-4	1-2	2-3	0-1	2-3	1-2	3-4	0-1	2-3
				Unit	Result	Result	Result	Result	Result	Result	Result	Result	Result	Result
Semi-Volatile Organic Compounds														
1,2,4,5-Tetrachlorobenzene	95-94-3	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
1,2,4-Trichlorobenzene	120-82-1	NS	NS	mg/kg	<0.2 U	0.027 J	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
1,2-Dichlorobenzene	95-50-1	1.1	100	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
1,3-Dichlorobenzene	541-73-1	2.4	49	mg/kg	<0.2 U	0.034 J	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
1,4-Dichlorobenzene	106-46-7	1.8	13	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
1,4-Dioxane (P-Dioxane)	123-91-1	0.1	13	mg/kg	<0.029 U	<0.029 U	<0.029 U	<0.029 U	<0.029 U	<0.034 U	<0.028 U	<0.029 U	<0.027 U	<0.028 U
2,4,5-Trichlorophenol	95-95-4	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
2,4,6-Trichlorophenol	88-06-2	NS	NS	mg/kg	<0.12 U	<0.12 U	<0.12 U	<0.12 U	<0.12 U	<0.14 U	<0.11 U	<0.12 U	<0.11 U	<0.11 U
2,4-Dichlorophenol	120-83-2	NS	NS	mg/kg	<0.18 U	<0.17 U	<0.17 U	<0.18 U	<0.17 U	<0.2 U	<0.17 U	<0.18 U	<0.16 U	<0.17 U
2,4-Dimethylphenol	105-67-9	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
2,4-Dinitrophenol	51-28-5	NS	NS	mg/kg	<0.94 U	<0.93 U	<0.93 U	<0.93 U	<0.93 U	<1.1 U	<0.9 U	<0.93 U	<0.88 U	<0.89 U
2,4-Dinitrotoluene	121-14-2	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
2,6-Dinitrotoluene	606-20-2	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
2-Chloronaphthalene	91-58-7	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
2-Chlorophenol	95-57-8	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
2-Methylnaphthalene	91-57-6	NS	NS	mg/kg	0.1 J	0.068 J	0.34	0.064 J	0.47	<0.27 U	0.026 J	<0.23 U	0.073 J	<0.22 U
2-Methylphenol (o-Cresol)	95-48-7	0.33	100	mg/kg	<0.2 U	<0.19 U	0.04 J	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
2-Nitroaniline	88-74-4	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
2-Nitrophenol	88-75-5	NS	NS	mg/kg	<0.42 U	<0.42 U	<0.42 U	<0.42 U	<0.42 U	<0.49 U	<0.4 U	<0.42 U	<0.4 U	<0.4 U
3 & 4 Methylphenol (m&p Cresol)	65794-96-9	0.33	100	mg/kg	<0.28 U	<0.28 U	0.11 J	0.047 J	0.071 J	<0.32 U	<0.27 U	<0.28 U	<0.26 U	<0.27 U
3,3'-Dichlorobenzidine	91-94-1	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
3-Nitroaniline	99-09-2	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
4,6-Dinitro-2-Methylphenol	534-52-1	NS	NS	mg/kg	<0.51 U	<0.5 U	<0.5 U	<0.5 U	<0.5 U	<0.59 U	<0.49 U	<0.51 U	<0.48 U	<0.48 U
4-Bromophenyl Phenyl Ether	101-55-3	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
4-Chloro-3-Methylphenol	59-50-7	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
4-Chloroaniline	106-47-8	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
4-Chlorophenyl Phenyl Ether	7005-72-3	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
4-Nitroaniline	100-01-6	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
4-Nitrophenol	100-02-7	NS	NS	mg/kg	<0.27 U	<0.27 U	<0.27 U	<0.27 U	<0.27 U	<0.32 U	<0.26 U	<0.27 U	<0.26 U	<0.26 U
Acenaphthene	83-32-9	20	100	mg/kg	0.14 J	0.037 J	0.42	0.06 J	0.68	<0.18 U	0.084 J	<0.16 U	0.02 J	<0.15 U
Acenaphthylene	208-96-8	100	100	mg/kg	0.28	0.1 J	0.32	0.18	0.23	<0.18 U	0.042 J	<0.16 U	0.082 J	<0.15 U
Acetophenone	98-86-2	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
Anthracene	120-12-7	100	100	mg/kg	0.56	0.12	0.94	0.24	2	<0.14 U	0.24	<0.12 U	0.1 J	<0.11 U
Benzo(a)anthracene	56-55-3	**1**	1	mg/kg	**2.3**	0.51	**2.8**	**1.4**	**3.3**	0.028 J	0.55	<0.12 U	0.54	<0.11 U
Benzo(a)pyrene	50-32-8	**1**	1	mg/kg	**2**	0.58	**2.9**	**1.5**	**2.4**	<0.18 U	0.43	<0.16 U	0.54	<0.15 U
Benzo(b)fluoranthene	205-99-2	**1**	1	mg/kg	**2.8**	0.8	**3.7**	**1.8**	**3.4**	<0.14 U	0.63	<0.12 U	0.76	<0.11 U
Benzo(g,h,i)Perylene	191-24-2	100	100	mg/kg	1.3	0.39	1.7	0.79	1.3	<0.18 U	0.26	<0.16 U	0.35	<0.15 U
Benzo(k)fluoranthene	207-08-9	**0.8**	3.9	mg/kg	**0.84**	0.23	**0.97**	0.64	**1.1**	<0.14 U	0.17	<0.12 U	0.22	<0.11 U
Benzoic Acid	65-85-0	NS	NS	mg/kg	<0.64 U	<0.63 U	<0.63 U	<0.63 U	<0.63 U	<0.73 U	0.19 J	<0.63 U	<0.59 U	<0.6 U
Benzyl Alcohol	100-51-6	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
Benzyl Butyl Phthalate	85-68-7	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
Biphenyl (Diphenyl)	92-52-4	NS	NS	mg/kg	<0.45 U	<0.44 U	0.083 J	<0.44 U	0.1 J	<0.51 U	<0.43 U	<0.44 U	<0.42 U	<0.42 U
Bis(2-chloroethoxy) methane	111-91-1	NS	NS	mg/kg	<0.21 U	<0.21 U	<0.21 U	<0.21 U	<0.21 U	<0.24 U	<0.2 U	<0.21 U	<0.2 U	<0.2 U
Bis(2-chloroethyl) ether (2-chloroethyl ether)	111-44-4	NS	NS	mg/kg	<0.18 U	<0.17 U	<0.17 U	<0.18 U	<0.17 U	<0.2 U	<0.17 U	<0.18 U	<0.16 U	<0.17 U
Bis(2-chloroisopropyl) ether	108-60-1	NS	NS	mg/kg	<0.24 U	<0.23 U	<0.23 U	<0.23 U	<0.23 U	<0.27 U	<0.22 U	<0.23 U	<0.22 U	<0.22 U
Bis(2-ethylhexyl) phthalate	117-81-7	NS	NS	mg/kg	0.16 J	<0.19 U	0.091 J	<0.19 U	0.28	<0.22 U	<0.19 U	<0.19 U	0.34	<0.19 U
Carbazole	86-74-8	NS	NS	mg/kg	0.21	0.049 J	0.43	0.068 J	1.1	<0.22 U	0.13 J	<0.19 U	0.041 J	<0.19 U
Chrysene	218-01-9	**1**	3.9	mg/kg	**2.1**	0.49	**2.5**	**1.2**	**2.9**	<0.14 U	0.57	<0.12 U	0.54	<0.11 U
Dibenz(a,h)anthracene	53-70-3	**0.33**	0.33	mg/kg	0.31	0.11 J	**0.44**	0.23	**0.39**	<0.14 U	0.07 J	<0.12 U	0.096 J	<0.11 U
Dibenzofuran	132-64-9	**7**	59	mg/kg	0.14 J	0.044 J	0.41	0.065 J	0.76	<0.22 U	0.061 J	<0.19 U	0.037 J	<0.19 U
Dibutyl phthalate	84-74-2	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
Diethyl phthalate	84-66-2	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
Dimethyl phthalate	131-11-3	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
Dioctyl phthalate	117-84-0	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
Fluoranthene	206-44-0	**100**	100	mg/kg	4	0.82	5.1	2.2	5.9	0.032 J	1.2	<0.12 U	0.79	<0.11 U
Fluorene	86-73-7	30	100	mg/kg	0.19 J	0.039 J	0.41	0.072 J	1	<0.22 U	0.084 J	<0.19 U	0.028 J	<0.19 U
Hexachlorobenzene	118-74-1	0.33	1.2	mg/kg	<0.12 U	<0.12 U	<0.12 U	<0.12 U	<0.12 U	<0.14 U	<0.11 U	<0.12 U	<0.11 U	<0.11 U
Hexachlorobutadiene	87-68-3	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
Hexachlorocyclopentadiene	77-47-4	NS	NS	mg/kg	<0.56 U	<0.56 U	<0.55 U	<0.56 U	<0.56 U	<0.64 U	<0.53 U	<0.56 U	<0.52 U	<0.53 U
Hexachloroethane	67-72-1	NS	NS	mg/kg	<0.16 U	<0.16 U	<0.15 U	<0.16 U	<0.16 U	<0.18 U	<0.15 U	<0.16 U	<0.15 U	<0.15 U
Indeno(1,2,3-cd)pyrene	193-39-5	**0.5**	0.5	mg/kg	**1.4**	0.34	**1.4**	**0.73**	**1.4**	<0.18 U	0.27	<0.16 U	0.3	<0.15 U
Isophorone	78-59-1	NS	NS	mg/kg	<0.18 U	<0.17 U	<0.17 U	<0.18 U	<0.17 U	<0.2 U	<0.17 U	<0.18 U	<0.16 U	<0.17 U
Naphthalene	91-20-3	12	100	mg/kg	0.18 J	0.31	0.76	0.19	1	<0.22 U	0.049 J	<0.19 U	0.07 J	<0.19 U
Nitrobenzene	98-95-3	NS	NS	mg/kg	<0.18 U	<0.17 U	<0.17 U	<0.18 U	<0.17 U	<0.2 U	<0.17 U	<0.18 U	<0.16 U	<0.17 U
n-Nitrosodi-N-Propylamine	621-64-7	NS	NS	mg/kg	<0.2 U	<0.19 U	<0.19 U	<0.19 U	<0.19 U	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
n-Nitrosodiphenylamine	86-30-6	NS	NS	mg/kg	<0.16 U	<0.16 U	<0.15 U	<0.16 U	<0.16 U	<0.18 U	<0.15 U	<0.16 U	<0.15 U	<0.15 U
Pentachlorophenol	87-86-5	0.8	6.7	mg/kg	<0.16 U	<0.16 U	<0.15 U	<0.16 U	<0.16 U	<0.18 U	<0.15 U	<0.16 U	<0.15 U	<0.15 U
Phenanthrene	85-01-8	**100**	100	mg/kg	1.9	0.42	3.9	0.74	6.7	<0.14 U	1	<0.12 U	0.43	<0.11 U
Phenol	108-95-2	0.33	100	mg/kg	<0.2 U	<0.19 U	0.065 J	0.032 J	0.035 J	<0.22 U	<0.19 U	<0.19 U	<0.18 U	<0.19 U
Pyrene	129-00-0	100	100	mg/kg	3.2	0.7	4.3	2	4.6	0.028 J	0.94	<0.12 U	0.64	<0.11 U

Table 2
Phase II Environmental Site Assessment Report
Soil Sample Analytical Results

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

Analyte	CAS Number	NYSDEC Part 375 Unrestricted Use SCOs	NYSDEC Part 375 Restricted Use Restricted-Residential SCOs	Location	P6SB06	P6SB06	P6SB07	P6SB07	P6SB08	P6SB08	P6SB09	P6SB09	P6SB10	P6SB10
				Sample Name	P6SB06_0-1	P6SB06_3-4	P6SB07_1-2	P6SB07_2-3	P6SB08_0-1	P6SB08_2-3	P6SB09_1-2	P6SB09_3-4	P6SB10_0-1	P6SB10_2-3
				Sample Date	10/15/2025	10/15/2025	10/15/2025	10/15/2025	10/16/2025	10/16/2025	10/16/2025	10/16/2025	10/15/2025	10/15/2025
				Sample Depth	0-1	3-4	1-2	2-3	0-1	2-3	1-2	3-4	0-1	2-3
				Unit	Result	Result	Result	Result	Result	Result	Result	Result	Result	Result
Pesticides														
4,4'-DDD	72-54-8	**0.0033**	13	mg/kg	<0.0019 U	NA	**0.00908 IP**	NA	<0.00187 U	NA	<0.00176 U	NA	<0.00179 U	NA
4,4'-DDE	72-55-9	**0.0033**	8.9	mg/kg	**0.0106**	NA	**0.0132**	NA	**0.0186**	NA	0.00218	NA	**0.0239**	NA
4,4'-DDT	50-29-3	**0.0033**	7.9	mg/kg	**0.0174**	NA	**0.0149**	NA	**0.0224**	NA	0.00254	NA	**0.0147**	NA
Aldrin	309-00-2	0.005	0.097	mg/kg	<0.0019 U	NA	<0.00187 U	NA	<0.00187 U	NA	<0.00176 U	NA	<0.00179 U	NA
Alpha BHC (Alpha Hexachlorocyclohexane)	319-84-6	0.02	0.48	mg/kg	<0.00079 U	NA	<0.000779 U	NA	<0.000779 U	NA	<0.000733 U	NA	<0.000744 U	NA
Alpha Chlordane	5103-71-9	0.094	4.2	mg/kg	0.000824 JIP	NA	<0.00234 U	NA	<0.00234 U	NA	<0.0022 U	NA	<0.00223 U	NA
Alpha Endosulfan	959-98-8	2.4	24	mg/kg	<0.0019 U	NA	<0.00187 U	NA	<0.00187 U	NA	<0.00176 U	NA	<0.00179 U	NA
Beta Bhc (Beta Hexachlorocyclohexane)	319-85-7	0.036	0.36	mg/kg	<0.0019 U	NA	<0.00187 U	NA	<0.00187 U	NA	<0.00176 U	NA	<0.00179 U	NA
Beta Endosulfan	33213-65-9	2.4	24	mg/kg	<0.0019 U	NA	<0.00187 U	NA	<0.00187 U	NA	<0.00176 U	NA	<0.00179 U	NA
Chlordane (alpha and gamma)	57-74-9	NS	NS	mg/kg	<0.0158 U	NA	<0.0156 U	NA	0.0176 IP	NA	<0.0147 U	NA	<0.0149 U	NA
Delta Bhc (Delta Hexachlorocyclohexane)	319-86-8	0.04	100	mg/kg	<0.0019 U	NA	<0.00187 U	NA	<0.00187 U	NA	<0.00176 U	NA	<0.00179 U	NA
Dieldrin	60-57-1	**0.005**	0.2	mg/kg	<0.00118 U	NA	<0.00117 U	NA	<0.00117 U	NA	<0.0011 U	NA	<0.00112 U	NA
Endosulfan Sulfate	1031-07-8	2.4	24	mg/kg	<0.00079 U	NA	<0.000779 U	NA	<0.000779 U	NA	<0.000733 U	NA	<0.000744 U	NA
Endrin	72-20-8	0.014	11	mg/kg	<0.00079 U	NA	<0.000779 U	NA	<0.000779 U	NA	<0.000733 U	NA	<0.000744 U	NA
Endrin Aldehyde	7421-93-4	NS	NS	mg/kg	<0.00237 U	NA	<0.00234 U	NA	<0.00234 U	NA	<0.0022 U	NA	<0.00223 U	NA
Endrin Ketone	53494-70-5	NS	NS	mg/kg	<0.0019 U	NA	<0.00187 U	NA	<0.00187 U	NA	<0.00176 U	NA	<0.00179 U	NA
Gamma Bhc (Lindane)	58-89-9	0.1	1.3	mg/kg	<0.00079 U	NA	<0.000779 U	NA	<0.000779 U	NA	<0.000733 U	NA	<0.000744 U	NA
Gamma Chlordane (Trans)	5103-74-2	NS	NS	mg/kg	0.00137 J	NA	<0.00234 U	NA	0.00226 J	NA	<0.0022 U	NA	0.000701 J	NA
Heptachlor	76-44-8	0.042	2.1	mg/kg	<0.000949 U	NA	<0.000934 U	NA	<0.000935 U	NA	<0.00088 U	NA	<0.000893 U	NA
Heptachlor Epoxide	1024-57-3	NS	NS	mg/kg	0.00304 J	NA	<0.0035 U	NA	<0.00351 U	NA	<0.0033 U	NA	<0.00335 U	NA
Methoxychlor	72-43-5	NS	NS	mg/kg	<0.00356 U	NA	<0.0035 U	NA	<0.00351 U	NA	<0.0033 U	NA	<0.00335 U	NA
Toxaphene	8001-35-2	NS	NS	mg/kg	<0.0356 U	NA	<0.035 U	NA	<0.0351 U	NA	<0.033 U	NA	<0.0335 U	NA
Herbicides														
2,4,5-T (Trichlorophenoxyacetic Acid)	93-76-5	NS	NS	mg/kg	<0.198 U	NA	<0.197 U	NA	<0.193 U	NA	<0.191 U	NA	<0.186 U	NA
2,4-D (Dichlorophenoxyacetic Acid)	94-75-7	NS	NS	mg/kg	<0.198 U	NA	<0.197 U	NA	<0.193 U	NA	<0.191 U	NA	<0.186 U	NA
Silvex (2,4,5-Tp)	93-72-1	3.8	100	mg/kg	<0.198 U	NA	<0.197 U	NA	<0.193 U	NA	<0.191 U	NA	<0.186 U	NA
Polychlorinated Biphenyl														
PCB-1016 (Aroclor 1016)	12674-11-2	NS	NS	mg/kg	<0.0604 U	<0.0574 U	<0.0583 U	<0.0584 U	<0.0542 U	<0.0645 U	<0.0554 U	<0.0575 U	<0.0538 U	<0.0543 U
PCB-1221 (Aroclor 1221)	11104-28-2	NS	NS	mg/kg	<0.0604 U	<0.0574 U	<0.0583 U	<0.0584 U	<0.0542 U	<0.0645 U	<0.0554 U	<0.0575 U	<0.0538 U	<0.0543 U
PCB-1232 (Aroclor 1232)	11141-16-5	NS	NS	mg/kg	<0.0604 U	<0.0574 U	<0.0583 U	<0.0584 U	<0.0542 U	<0.0645 U	<0.0554 U	<0.0575 U	<0.0538 U	<0.0543 U
PCB-1242 (Aroclor 1242)	53469-21-9	NS	NS	mg/kg	<0.0604 U	<0.0574 U	<0.0583 U	<0.0584 U	<0.0542 U	<0.0645 U	<0.0554 U	<0.0575 U	<0.0538 U	<0.0543 U
PCB-1248 (Aroclor 1248)	12672-29-6	NS	NS	mg/kg	<0.0604 U	<0.0574 U	<0.0583 U	<0.0584 U	<0.0542 U	<0.0645 U	<0.0554 U	<0.0575 U	<0.0538 U	<0.0543 U
PCB-1254 (Aroclor 1254)	11097-69-1	NS	NS	mg/kg	<0.0604 U	<0.0574 U	<0.0583 U	<0.0584 U	0.0111 J	<0.0645 U	<0.0554 U	<0.0575 U	<0.0538 U	<0.0543 U
PCB-1260 (Aroclor 1260)	11096-82-5	NS	NS	mg/kg	0.0168 J	<0.0574 U	<0.0583 U	<0.0584 U	0.0182 J	<0.0645 U	<0.0554 U	<0.0575 U	0.0118 J	<0.0543 U
PCB-1262 (Aroclor 1262)	37324-23-5	NS	NS	mg/kg	<0.0604 U	<0.0574 U	<0.0583 U	<0.0584 U	<0.0542 U	<0.0645 U	<0.0554 U	<0.0575 U	<0.0538 U	<0.0543 U
PCB-1268 (Aroclor 1268)	11100-14-4	NS	NS	mg/kg	0.00646 J	<0.0574 U	<0.0583 U	<0.0584 U	<0.0542 U	<0.0645 U	<0.0554 U	<0.0575 U	<0.0538 U	<0.0543 U
Total PCBs	1336-36-3	0.1	1	mg/kg	0.0233 J	<0.0574 U	<0.0583 U	<0.0584 U	0.0293 J	<0.0645 U	<0.0554 U	<0.0575 U	0.0118 J	<0.0543 U
Metals														
Aluminum	7429-90-5	NS	NS	mg/kg	8,250	9,160	6,400	6,710	7,810	8,350	8,810	10,900	8,590	13,100
Antimony	7440-36-0	NS	NS	mg/kg	<4.74 U	<4.47 U	<4.66 U	<4.56 U	<4.52 U	<5.22 U	<4.34 U	<4.46 U	<4.27 U	<4.51 U
Arsenic	7440-38-2	13	16	mg/kg	6.16	8.14	6.64	6.41	8.53	6.35	9.21	3.14	5.68	3.02
Barium	7440-39-3	**350**	400	mg/kg	194	105	208	166	235	107	274	69.4	146	51.9
Beryllium	7440-41-7	7.2	72	mg/kg	0.5	0.456	0.419 J	0.405 J	0.446 J	0.43 J	0.486	0.505	0.526	0.599
Cadmium	7440-43-9	2.5	4.3	mg/kg	0.584 J	<0.894 U	0.356 J	0.266 J	1.18	0.325 J	0.41 J	0.143 J	0.481 J	<0.902 U
Calcium	7440-70-2	NS	NS	mg/kg	51,200	53,400	38,100	45,700	33,700	73,900	29,000	15,300	50,800	11,400
Chromium, Hexavalent	18540-29-9	1	110	mg/kg	<0.972 U	<0.938 U	<0.957 U	<0.952 U	<0.949 U	<1.1 U	<0.917 U	<0.943 U	<0.903 U	<0.92 U
Chromium, Total	7440-47-3	NS	NS	mg/kg	15.3	14.8	11.4	11.1	15.2	14.7	12.9	16.5	14.2	19.3
Chromium, Trivalent	16065-83-1	30	180	mg/kg	15.3	14.8	11.4	11.1	15.2	14.7	12.9	16.5	14.2	19.3
Cobalt	7440-48-4	NS	NS	mg/kg	7.62	9.63	5.86	6.51	7.9	8.32	7.56	9.86	7.4	10.6
Copper	7440-50-8	**50**	270	mg/kg	49.9	**55.3**	**59.1**	**51.5**	**53.9**	46.9	**85.9**	23.4	**51.9**	17.8
Cyanide	57-12-5	27	27	mg/kg	<1.1 U	0.31 J	<1.2 U	<1.1 U	<1.1 U	0.33 J	0.28 J	<1.1 U	<1 U	<1.1 U
Iron	7439-89-6	NS	NS	mg/kg	16,800	17,900	11,400	13,200	11,100	12,300	11,500	16,600	16,200	21,900
Lead	7439-92-1	**63**	400	mg/kg	**230**	**183**	**417**	**194**	**176**	**278**	**938**	62.4	**290**	20.4
Magnesium	7439-95-4	NS	NS	mg/kg	15,600	15,400	8,940	12,400	5,090	26,900	8,700	9,150	12,700	10,000
Manganese	7439-96-5	1600	2000	mg/kg	390	542	272	324	394	373	230	185	451	310
Mercury	7439-97-6	**0.18**	0.81	mg/kg	**0.559**	**0.61**	**0.5**	**0.477**	**0.213**	**0.319**	**0.837**	<0.079 U	**0.293**	0.051 J
Nickel	7440-02-0	**30**	310	mg/kg	21	24.7	15	15.8	29.6	21.2	19.8	26.8	22.1	28.3
Potassium	7440-09-7	NS	NS	mg/kg	1,010	964	820	836	899	1,100	892	678	910	810
Selenium	7782-49-2	3.9	180	mg/kg	0.362 J	<1.79 U	<1.87 U	<1.82 U	<1.81 U	<2.09 U	<1.74 U	<1.78 U	<1.71 U	<1.8 U
Silver	7440-22-4	2	180	mg/kg	0.652	<0.447 U	<0.466 U	0.272 J	<0.452 U	<0.522 U	0.292 J	<0.446 U	<0.427 U	<0.451 U
Sodium	7440-23-5	NS	NS	mg/kg	<190 U	105 J	142 J	113 J	110 J	350	238	<178 U	<171 U	209
Thallium	7440-28-0	NS	NS	mg/kg	<1.9 U	<1.79 U	<1.87 U	<1.82 U	<1.81 U	<2.09 U	<1.74 U	<1.78 U	<1.71 U	<1.8 U
Vanadium	7440-62-2	NS	NS	mg/kg	19.9	20.8	18.2	18.4	22.4	17.9	22.7	19.2	18.8	21.9
Zinc	7440-66-6	**109**	10000	mg/kg	**168**	94.6	**145**	**117**	**195**	**170**	**213**	69.3	**136**	57.8
General Chemistry														
Solids, Percent	SOLID	NS	NS	Percent	82.3	85.3	83.6	84	84.3	72.9	87.2	84.8	88.6	87

Table 2
Phase II Environmental Site Assessment Report
Soil Sample Analytical Results

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

Notes:

CAS - Chemical Abstract Service
NS - No standard
mg/kg - milligram per kilogram
NA - Not analyzed
RL - Reporting limit
<RL - Not detected
Soil sample analytical results are compared to the New York State Department of Environmental Conservation (NYSDEC) Title 6 of the Official Compilation of New York Codes, Rules, and Regulations (NYCRR) Part 375 Unrestricted Use and Restricted Use Restricted-Residential Soil Cleanup Objectives (SCO).
Criterion comparisons for 3- & 4-methylphenol (m&p cresol) are provided for reference. Promulgated SCOs are for 3-methylphenol (m-cresol) and 4-methylphenol (p-cresol).

Qualifiers:

I - The lower value for the two columns has been reported due to obvious interference.
J - The analyte was detected above the method detection limit (MDL), but below the RL; therefore, the result is an estimated concentration.
P - The relative percent difference (RPD) between the results for the two columns exceeds the method-specified criteria.
U - The analyte was analyzed for, but was not detected at a level greater than or equal to the RL; the value shown in the table is the RL.
B - The analyte was found in the associated analysis batch blank.

Exceedance Summary:

10 - Result exceeds Unrestricted Use SCOs
10 - Result exceeds Restricted Use Restricted-Residential SCOs

Table 3
Phase II Environmental Site Assessment Report
Groundwater Sample Analytical Results

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

Analyte	CAS Number	NYSDEC SGVs	Location	P6TMW02	P6TMW03	P6TMW09	P6TMW10
			Sample Name	P6TMW02_101625	P6TMW03_101525	P6TMW09_101625	P6TMW10_101625
			Sample Date	10/16/2025	10/15/2025	10/16/2025	10/16/2025
			Unit	Result	Result	Result	Result
Volatile Organic Compounds							
1,1,1,2-Tetrachloroethane	630-20-6	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,1,1-Trichloroethane	71-55-6	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,1,2,2-Tetrachloroethane	79-34-5	5	ug/l	<0.5 U	<0.5 U	<0.5 U	<0.5 U
1,1,2-Trichloroethane	79-00-5	1	ug/l	<1.5 U	<1.5 U	<1.5 U	<1.5 U
1,1-Dichloroethane	75-34-3	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,1-Dichloroethene	75-35-4	5	ug/l	<0.5 U	<0.5 U	<0.5 U	<0.5 U
1,1-Dichloropropene	563-58-6	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,2,3-Trichlorobenzene	87-61-6	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,2,3-Trichloropropane	96-18-4	0.04	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,2,4,5-Tetramethylbenzene	95-93-2	5	ug/l	<2 U	<2 U	<2 U	<2 U
1,2,4-Trichlorobenzene	120-82-1	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,2,4-Trimethylbenzene	95-63-6	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,2-Dibromo-3-Chloropropane	96-12-8	0.04	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,2-Dibromoethane (Ethylene Dibromide)	106-93-4	0.0006	ug/l	<2 U	<2 U	<2 U	<2 U
1,2-Dichlorobenzene	95-50-1	3	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,2-Dichloroethane	107-06-2	0.6	ug/l	<0.5 U	<0.5 U	<0.5 U	<0.5 U
1,2-Dichloropropane	78-87-5	1	ug/l	<1 U	<1 U	<1 U	<1 U
1,3,5-Trimethylbenzene (Mesitylene)	108-67-8	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,3-Dichlorobenzene	541-73-1	3	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,3-Dichloropropane	142-28-9	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,4-Dichlorobenzene	106-46-7	3	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
1,4-Diethyl Benzene	105-05-5	NS	ug/l	<2 U	<2 U	<2 U	<2 U
1,4-Dioxane (P-Dioxane)	123-91-1	0.35	ug/l	<250 U	<250 U	<250 U	<250 U
2,2-Dichloropropane	594-20-7	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
2-Chlorotoluene	95-49-8	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
2-Hexanone (MBK)	591-78-6	50	ug/l	<5 U	<5 U	<5 U	<5 U
4-Chlorotoluene	106-43-4	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
4-Ethyltoluene	622-96-8	NS	ug/l	<2 U	<2 U	<2 U	<2 U
Acetone	67-64-1	50	ug/l	2.9 J	2.1 J	5	5.5
Acrylonitrile	107-13-1	5	ug/l	<5 U	<5 U	<5 U	<5 U
Benzene	71-43-2	1	ug/l	<0.5 U	<0.5 U	<0.5 U	<0.5 U
Bromobenzene	108-86-1	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Bromochloromethane	74-97-5	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Bromodichloromethane	75-27-4	50	ug/l	<0.5 U	<0.5 U	<0.5 U	<0.5 U
Bromoform	75-25-2	50	ug/l	<2 U	<2 U	<2 U	<2 U
Bromomethane	74-83-9	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Carbon Disulfide	75-15-0	60	ug/l	<5 U	<5 U	<5 U	<5 U
Carbon Tetrachloride	56-23-5	5	ug/l	<0.5 U	<0.5 U	<0.5 U	<0.5 U
Chlorobenzene	108-90-7	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Chloroethane	75-00-3	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Chloroform	67-66-3	7	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Chloromethane	74-87-3	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Cis-1,2-Dichloroethene	156-59-2	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Cis-1,3-Dichloropropene	10061-01-5	0.4	ug/l	<0.5 U	<0.5 U	<0.5 U	<0.5 U
Cymene	99-87-6	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Dibromochloromethane	124-48-1	50	ug/l	<0.5 U	<0.5 U	<0.5 U	<0.5 U
Dibromomethane	74-95-3	5	ug/l	<5 U	<5 U	<5 U	<5 U
Dichlorodifluoromethane	75-71-8	5	ug/l	<5 U	<5 U	<5 U	<5 U
Diethyl Ether (Ethyl Ether)	60-29-7	NS	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Ethylbenzene	100-41-4	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Hexachlorobutadiene	87-68-3	0.5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Isopropylbenzene (Cumene)	98-82-8	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
M,P-Xylene	179601-23-1	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Methyl Ethyl Ketone (2-Butanone)	78-93-3	50	ug/l	<5 U	<5 U	<5 U	<5 U
Methyl Isobutyl Ketone (4-Methyl-2-Pentanone)	108-10-1	NS	ug/l	<5 U	<5 U	<5 U	<5 U
Methylene Chloride	75-09-2	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Naphthalene	91-20-3	10	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
n-Butylbenzene	104-51-8	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
n-Propylbenzene	103-65-1	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
o-Xylene (1,2-Dimethylbenzene)	95-47-6	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Sec-Butylbenzene	135-98-8	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Styrene	100-42-5	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
T-Butylbenzene	98-06-6	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Tert-Butyl Methyl Ether (MTBE)	1634-04-4	10	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Tetrachloroethene (PCE)	127-18-4	5	ug/l	<0.5 U	<0.5 U	<0.5 U	<0.5 U
Toluene	108-88-3	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Total 1,2-Dichloroethene (Cis and Trans)	540-59-0	NS	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Total Xylenes	1330-20-7	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Total, 1,3-Dichloropropene (Cis And Trans)	542-75-6	0.4	ug/l	<0.5 U	<0.5 U	<0.5 U	<0.5 U
Trans-1,2-Dichloroethene	156-60-5	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Trans-1,3-Dichloropropene	10061-02-6	0.4	ug/l	<0.5 U	<0.5 U	<0.5 U	<0.5 U
Trans-1,4-Dichloro-2-Butene	110-57-6	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Trichloroethene (TCE)	79-01-6	5	ug/l	<0.5 U	<0.5 U	<0.5 U	<0.5 U
Trichlorofluoromethane	75-69-4	5	ug/l	<2.5 U	<2.5 U	<2.5 U	<2.5 U
Vinyl Acetate	108-05-4	NS	ug/l	<5 U	<5 U	<5 U	<5 U
Vinyl Chloride	75-01-4	2	ug/l	<1 U	<1 U	<1 U	<1 U

Table 3
Phase II Environmental Site Assessment Report
Groundwater Sample Analytical Results

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

Analyte	CAS Number	NYSDEC SGVs	Location	P6TMW02	P6TMW03	P6TMW09	P6TMW10
			Sample Name	P6TMW02_101625	P6TMW03_101525	P6TMW09_101625	P6TMW10_101625
			Sample Date	10/16/2025	10/15/2025	10/16/2025	10/16/2025
			Unit	Result	Result	Result	Result
Semi-Volatile Organic Compounds							
1,2,4,5-Tetrachlorobenzene	95-94-3	5	ug/l	<10 U	<10 U	NA	NA
1,2,4-Trichlorobenzene	120-82-1	5	ug/l	<5 U	<5 U	NA	NA
1,2-Dichlorobenzene	95-50-1	3	ug/l	<2 U	<2 U	NA	NA
1,3-Dichlorobenzene	541-73-1	3	ug/l	<2 U	<2 U	NA	NA
1,4-Dichlorobenzene	106-46-7	3	ug/l	<2 U	<2 U	NA	NA
2,4,5-Trichlorophenol	95-95-4	NS	ug/l	<5 U	<5 U	NA	NA
2,4,6-Trichlorophenol	88-06-2	NS	ug/l	<5 U	<5 U	NA	NA
2,4-Dichlorophenol	120-83-2	1	ug/l	<5 U	<5 U	NA	NA
2,4-Dimethylphenol	105-67-9	1	ug/l	<5 U	<5 U	NA	NA
2,4-Dinitrophenol	51-28-5	1	ug/l	<20 U	<20 U	NA	NA
2,4-Dinitrotoluene	121-14-2	5	ug/l	<5 U	<5 U	NA	NA
2,6-Dinitrotoluene	606-20-2	5	ug/l	<5 U	<5 U	NA	NA
2-Chloronaphthalene	91-58-7	10	ug/l	<0.2 U	<0.2 U	NA	NA
2-Chlorophenol	95-57-8	NS	ug/l	<2 U	<2 U	NA	NA
2-Methylnaphthalene	91-57-6	NS	ug/l	0.05 J	<0.1 U	NA	NA
2-Methylphenol (o-Cresol)	95-48-7	NS	ug/l	<5 U	<5 U	NA	NA
2-Nitroaniline	88-74-4	5	ug/l	<5 U	<5 U	NA	NA
2-Nitrophenol	88-75-5	NS	ug/l	<10 U	<10 U	NA	NA
3 & 4 Methylphenol (m&p Cresol)	65794-96-9	NS	ug/l	<5 U	<5 U	NA	NA
3,3'-Dichlorobenzidine	91-94-1	5	ug/l	<5 U	<5 U	NA	NA
3-Nitroaniline	99-09-2	5	ug/l	<5 U	<5 U	NA	NA
4,6-Dinitro-2-Methylphenol	534-52-1	NS	ug/l	<10 U	<10 U	NA	NA
4-Bromophenyl Phenyl Ether	101-55-3	NS	ug/l	<2 U	<2 U	NA	NA
4-Chloro-3-Methylphenol	59-50-7	NS	ug/l	<2 U	<2 U	NA	NA
4-Chloroaniline	106-47-8	5	ug/l	<5 U	<5 U	NA	NA
4-Chlorophenyl Phenyl Ether	7005-72-3	NS	ug/l	<2 U	<2 U	NA	NA
4-Nitroaniline	100-01-6	5	ug/l	<5 U	<5 U	NA	NA
4-Nitrophenol	100-02-7	NS	ug/l	<10 U	<10 U	NA	NA
Acenaphthene	83-32-9	20	ug/l	0.05 J	<0.1 U	NA	NA
Acenaphthylene	208-96-8	NS	ug/l	0.04 J	<0.1 U	NA	NA
Acetophenone	98-86-2	NS	ug/l	<5 U	<5 U	NA	NA
Anthracene	120-12-7	50	ug/l	0.12	<0.1 U	NA	NA
Benzo(a)anthracene	56-55-3	**0.002**	ug/l	**0.24**	**0.04 J**	NA	NA
Benzo(a)pyrene	50-32-8	**0**	ug/l	**0.2**	<0.1 U	NA	NA
Benzo(b)fluoranthene	205-99-2	**0.002**	ug/l	**0.25**	<0.1 U	NA	NA
Benzo(g,h,i)Perylene	191-24-2	NS	ug/l	0.09 J	<0.1 U	NA	NA
Benzo(k)fluoranthene	207-08-9	**0.002**	ug/l	**0.09 J**	<0.1 U	NA	NA
Benzoic Acid	65-85-0	NS	ug/l	8.5 J	8.1 J	NA	NA
Benzyl Alcohol	100-51-6	NS	ug/l	<2 U	<2 U	NA	NA
Benzyl Butyl Phthalate	85-68-7	50	ug/l	<5 U	<5 U	NA	NA
Biphenyl (Diphenyl)	92-52-4	5	ug/l	<2 U	<2 U	NA	NA
Bis(2-chloroethoxy) methane	111-91-1	5	ug/l	<5 U	<5 U	NA	NA
Bis(2-chloroethyl) ether (2-chloroethyl ether)	111-44-4	1	ug/l	<2 U	<2 U	NA	NA
Bis(2-chloroisopropyl) ether	108-60-1	5	ug/l	<2 U	<2 U	NA	NA
Bis(2-ethylhexyl) phthalate	117-81-7	5	ug/l	<3 U	<3 U	NA	NA
Carbazole	86-74-8	NS	ug/l	<2 U	<2 U	NA	NA
Chrysene	218-01-9	**0.002**	ug/l	**0.19**	<0.1 U	NA	NA
Dibenz(a,h)anthracene	53-70-3	NS	ug/l	<0.1 U	<0.1 U	NA	NA
Dibenzofuran	132-64-9	NS	ug/l	<2 U	<2 U	NA	NA
Dibutyl phthalate	84-74-2	50	ug/l	<5 U	<5 U	NA	NA
Diethyl phthalate	84-66-2	50	ug/l	<5 U	<5 U	NA	NA
Dimethyl phthalate	131-11-3	50	ug/l	<5 U	<5 U	NA	NA
Dioctyl phthalate	117-84-0	50	ug/l	<5 U	<5 U	NA	NA
Fluoranthene	206-44-0	50	ug/l	0.59	<0.1 U	NA	NA
Fluorene	86-73-7	50	ug/l	0.05 J	<0.1 U	NA	NA
Hexachlorobenzene	118-74-1	0.04	ug/l	<0.8 U	<0.8 U	NA	NA
Hexachlorobutadiene	87-68-3	0.5	ug/l	<0.5 U	<0.5 U	NA	NA
Hexachlorocyclopentadiene	77-47-4	5	ug/l	<20 U	<20 U	NA	NA
Hexachloroethane	67-72-1	5	ug/l	<0.8 U	<0.8 U	NA	NA
Indeno(1,2,3-cd)pyrene	193-39-5	**0.002**	ug/l	**0.1 J**	<0.1 U	NA	NA
Isophorone	78-59-1	50	ug/l	<5 U	<5 U	NA	NA
Naphthalene	91-20-3	10	ug/l	0.03 J	<0.1 U	NA	NA
Nitrobenzene	98-95-3	0.4	ug/l	<2 U	<2 U	NA	NA
n-Nitrosodi-N-Propylamine	621-64-7	NS	ug/l	<5 U	<5 U	NA	NA
n-Nitrosodiphenylamine	86-30-6	50	ug/l	<2 U	<2 U	NA	NA
Pentachlorophenol	87-86-5	1	ug/l	0.08 J	<0.8 U	NA	NA
Phenanthrene	85-01-8	50	ug/l	0.34	<0.1 U	NA	NA
Phenol	108-95-2	1	ug/l	<5 U	<5 U	NA	NA
Pyrene	129-00-0	50	ug/l	0.47	<0.1 U	NA	NA
Polychlorinated Biphenyl							
PCB-1016 (Aroclor 1016)	12674-11-2	NS	ug/l	<0.071 U	<0.071 U	NA	NA
PCB-1221 (Aroclor 1221)	11104-28-2	NS	ug/l	<0.071 U	<0.071 U	NA	NA
PCB-1232 (Aroclor 1232)	11141-16-5	NS	ug/l	<0.071 U	<0.071 U	NA	NA
PCB-1242 (Aroclor 1242)	53469-21-9	NS	ug/l	<0.071 U	<0.071 U	NA	NA
PCB-1248 (Aroclor 1248)	12672-29-6	NS	ug/l	<0.071 U	<0.071 U	NA	NA
PCB-1254 (Aroclor 1254)	11097-69-1	NS	ug/l	<0.071 U	<0.071 U	NA	NA
PCB-1260 (Aroclor 1260)	11096-82-5	NS	ug/l	<0.071 U	<0.071 U	NA	NA
PCB-1262 (Aroclor 1262)	37324-23-5	NS	ug/l	<0.071 U	<0.071 U	NA	NA
PCB-1268 (Aroclor 1268)	11100-14-4	NS	ug/l	<0.071 U	<0.071 U	NA	NA
Total PCBs	1336-36-3	0.09	ug/l	<0.071 U	<0.071 U	NA	NA

Table 3
Phase II Environmental Site Assessment Report
Groundwater Sample Analytical Results

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

Analyte	CAS Number	NYSDEC SGVs	Location	P6TMW02	P6TMW03	P6TMW09	P6TMW10
			Sample Name	P6TMW02_101625	P6TMW03_101525	P6TMW09_101625	P6TMW10_101625
			Sample Date	10/16/2025	10/15/2025	10/16/2025	10/16/2025
			Unit	Result	Result	Result	Result
Metals - Dissolved							
Aluminum	7429-90-5	NS	ug/l	<20 U	<10 U	NA	NA
Antimony	7440-36-0	3	ug/l	<8 U	<4 U	NA	NA
Arsenic	7440-38-2	25	ug/l	<1 U	0.53	NA	NA
Barium	7440-39-3	1000	ug/l	87.63	139	NA	NA
Beryllium	7440-41-7	3	ug/l	<1 U	<0.5 U	NA	NA
Cadmium	7440-43-9	5	ug/l	<0.4 U	<0.2 U	NA	NA
Calcium	7440-70-2	NS	ug/l	280,000	162,000	NA	NA
Chromium, Total	7440-47-3	50	ug/l	<2 U	<1 U	NA	NA
Cobalt	7440-48-4	NS	ug/l	3.07	1.06	NA	NA
Copper	7440-50-8	200	ug/l	2.11	0.62 J	NA	NA
Iron	7439-89-6	300	ug/l	64.3 J	23 J	NA	NA
Lead	7439-92-1	25	ug/l	<2 U	<1 U	NA	NA
Magnesium	7439-95-4	**35000**	ug/l	**64,600**	26,900	NA	NA
Manganese	7439-96-5	**300**	ug/l	**1,114**	**719.6**	NA	NA
Mercury	7439-97-6	0.7	ug/l	<0.2 U	<0.2 U	NA	NA
Nickel	7440-02-0	100	ug/l	4.89	1.25 J	NA	NA
Potassium	7440-09-7	NS	ug/l	2,150	1,160	NA	NA
Selenium	7782-49-2	10	ug/l	<10 U	5.17	NA	NA
Silver	7440-22-4	50	ug/l	<0.8 U	<0.4 U	NA	NA
Sodium	7440-23-5	**20000**	ug/l	**630,000**	**53,600**	NA	NA
Thallium	7440-28-0	0.5	ug/l	<2 U	<1 U	NA	NA
Vanadium	7440-62-2	NS	ug/l	<10 U	<5 U	NA	NA
Zinc	7440-66-6	2000	ug/l	<20 U	<10 U	NA	NA
Metals - Total							
Aluminum	7429-90-5	NS	ug/l	12,800	20,400	NA	NA
Antimony	7440-36-0	3	ug/l	<4 U	<4 U	NA	NA
Arsenic	7440-38-2	25	ug/l	4.71	7.2	NA	NA
Barium	7440-39-3	1000	ug/l	282	726.2	NA	NA
Beryllium	7440-41-7	3	ug/l	0.82	1.69	NA	NA
Cadmium	7440-43-9	5	ug/l	0.13 J	0.39	NA	NA
Calcium	7440-70-2	NS	ug/l	352,000	608,000	NA	NA
Chromium, Hexavalent	18540-29-9	50	ug/l	<50 U	<50 U	NA	NA
Chromium, Total	7440-47-3	NS	ug/l	24	36.8	NA	NA
Chromium, Trivalent	16065-83-1	NS	ug/l	24 J	36 J	NA	NA
Cobalt	7440-48-4	NS	ug/l	20.2	38.85	NA	NA
Copper	7440-50-8	200	ug/l	48.87	76.87	NA	NA
Cyanide	57-12-5	200	ug/l	<5 U	2 J	NA	NA
Iron	7439-89-6	**300**	ug/l	**31,000**	**45,700**	NA	NA
Lead	7439-92-1	**25**	ug/l	**32.74**	**60.24**	NA	NA
Magnesium	7439-95-4	**35000**	ug/l	**87,800**	**181,000**	NA	NA
Manganese	7439-96-5	**300**	ug/l	**1,498**	**3,629**	NA	NA
Mercury	7439-97-6	0.7	ug/l	<0.2 U	0.21	NA	NA
Nickel	7440-02-0	100	ug/l	48.66	62.86	NA	NA
Potassium	7440-09-7	NS	ug/l	3,400	3,300	NA	NA
Selenium	7782-49-2	10	ug/l	3.58 J	7.31	NA	NA
Silver	7440-22-4	50	ug/l	0.21 J	<0.4 U	NA	NA
Sodium	7440-23-5	**20000**	ug/l	**596,000**	**52,700**	NA	NA
Thallium	7440-28-0	0.5	ug/l	0.28 J	0.29 J	NA	NA
Vanadium	7440-62-2	NS	ug/l	24.07	39.82	NA	NA
Zinc	7440-66-6	2000	ug/l	83.02	102.6	NA	NA

Table 3
Phase II Environmental Site Assessment Report
Groundwater Sample Analytical Results

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

Notes:

CAS - Chemical Abstract Service
NS - No standard
ug/l - microgram per liter
NA - Not analyzed
RL - Reporting limit
<RL - Not detected
Groundwater sample analytical results are compared to the New York State Department of Environmental Conservation (NYSDEC) Title 6 Codes, Rules, and Regulations (NYCRR) Part 703.5 and the NYSDEC Technical and Operation Guidance Series (TOGS) 1.1.1 Ambient Water Quality Standards and Guidance Values for Class GA Water and published addenda (herein collectively referenced as "NYSDEC SGVs").

Qualifiers:

J - The analyte was detected above the method detection limit (MDL), but below the RL; therefore, the result is an estimated concentration.
U - The analyte was analyzed for, but was not detected at a level greater than or equal to the RL; the value shown in the table is the RL.

Exceedance Summary:

10 - Result exceeds NYSDEC SGVs

Table 4
Phase II Environmental Site Assessment Report
Soil Vapor Sample Analytical Results

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

Analyte	CAS Number	Location	P6AA01	P6SV02	P6SV03	P6SV09	P6SV10
		Sample Name	P6AA01_101625	P6SV02_101625	P6SV03_101625	P6SV09_101625	P6SV10_101625
		Sample Date	10/16/2025	10/16/2025	10/16/2025	10/16/2025	10/16/2025
		Sample Type	AA	SV	SV	SV	SV
		Unit	Result	Result	Result	Result	Result
Volatile Organic Compounds							
1,1,1-Trichloroethane	71-55-6	ug/m3	<1.09 U	<1.13 U	<3.41 U	<1.09 U	<5.46 U
1,1,2,2-Tetrachloroethane	79-34-5	ug/m3	<1.37 U	<1.42 U	<4.29 U	<1.37 U	<6.87 U
1,1,2-Trichloro-1,2,2-Trifluoroethane	76-13-1	ug/m3	<1.53 U	<1.59 U	<4.79 U	<1.53 U	<7.66 U
1,1,2-Trichloroethane	79-00-5	ug/m3	<1.09 U	<1.13 U	<3.41 U	<1.09 U	<5.46 U
1,1-Dichloroethane	75-34-3	ug/m3	<0.809 U	<0.838 U	<2.53 U	<0.809 U	<4.05 U
1,1-Dichloroethene	75-35-4	ug/m3	<0.793 U	<0.821 U	<2.48 U	<0.793 U	<3.96 U
1,2,4-Trichlorobenzene	120-82-1	ug/m3	<1.48 U	<1.54 U	<4.64 U	<1.48 U	<7.42 U
1,2,4-Trimethylbenzene	95-63-6	ug/m3	<0.983 U	1.98	<3.07 U	<0.983 U	<4.92 U
1,2-Dibromoethane (Ethylene Dibromide)	106-93-4	ug/m3	<1.54 U	<1.59 U	<4.8 U	<1.54 U	<7.69 U
1,2-Dichlorobenzene	95-50-1	ug/m3	<1.2 U	<1.24 U	<3.76 U	<1.2 U	<6.01 U
1,2-Dichloroethane	107-06-2	ug/m3	<0.809 U	<0.838 U	<2.53 U	<0.809 U	<4.05 U
1,2-Dichloropropane	78-87-5	ug/m3	<0.924 U	<0.957 U	<2.89 U	<0.924 U	<4.62 U
1,2-Dichlorotetrafluoroethane	76-14-2	ug/m3	<1.4 U	<1.45 U	<4.37 U	<1.4 U	<6.99 U
1,3,5-Trimethylbenzene (Mesitylene)	108-67-8	ug/m3	<0.983 U	1.5	<3.07 U	<0.983 U	<4.92 U
1,3-Butadiene	106-99-0	ug/m3	<0.442 U	4.51	<1.38 U	<0.442 U	<2.21 U
1,3-Dichlorobenzene	541-73-1	ug/m3	<1.2 U	<1.24 U	<3.76 U	<1.2 U	<6.01 U
1,4-Dichlorobenzene	106-46-7	ug/m3	<1.2 U	<1.24 U	<3.76 U	<1.2 U	<6.01 U
1,4-Dioxane (P-Dioxane)	123-91-1	ug/m3	<0.721 U	<0.746 U	<2.25 U	<0.721 U	<3.6 U
2,2,4-Trimethylpentane	540-84-1	ug/m3	<0.934 U	63.1	<2.92 U	<0.934 U	<4.67 U
2-Hexanone (MBK)	591-78-6	ug/m3	<0.82 U	229	349	363	351
4-Ethyltoluene	622-96-8	ug/m3	<0.983 U	<1.02 U	<3.07 U	<0.983 U	<4.92 U
Acetone	67-64-1	ug/m3	5.13	287	340	420	432
Allyl Chloride (3-Chloropropene)	107-05-1	ug/m3	<0.626 U	<0.648 U	<1.96 U	<0.626 U	<3.13 U
Benzene	71-43-2	ug/m3	<0.639 U	6.84	<2 U	1.39	<3.19 U
Benzyl Chloride	100-44-7	ug/m3	<1.04 U	<1.07 U	<3.24 U	<1.04 U	<5.18 U
Bromodichloromethane	75-27-4	ug/m3	<1.34 U	<1.39 U	5.92	<1.34 U	<6.7 U
Bromoethene	593-60-2	ug/m3	<0.874 U	<0.905 U	<2.73 U	<0.874 U	<4.37 U
Bromoform	75-25-2	ug/m3	<2.07 U	<2.14 U	<6.46 U	<2.07 U	<10.3 U
Bromomethane	74-83-9	ug/m3	<0.777 U	<0.804 U	<2.43 U	<0.777 U	<3.88 U
Carbon Disulfide	75-15-0	ug/m3	<0.623 U	28.4	<1.95 U	1.52	5.04
Carbon Tetrachloride	56-23-5	ug/m3	<1.26 U	<1.3 U	<3.93 U	<1.26 U	<6.29 U
Chlorobenzene	108-90-7	ug/m3	<0.921 U	<0.953 U	<2.88 U	<0.921 U	<4.61 U
Chloroethane	75-00-3	ug/m3	<0.528 U	<0.546 U	<1.65 U	<0.528 U	<2.64 U
Chloroform	67-66-3	ug/m3	<0.977 U	<1.01 U	69.3	<0.977 U	9.52
Chloromethane	74-87-3	ug/m3	1.04	0.611	<1.29 U	<0.413 U	<2.07 U
Cis-1,2-Dichloroethene	156-59-2	ug/m3	<0.793 U	<0.821 U	<2.48 U	<0.793 U	<3.96 U
Cis-1,3-Dichloropropene	10061-01-5	ug/m3	<0.908 U	<0.94 U	<2.84 U	<0.908 U	<4.54 U
Cyclohexane	110-82-7	ug/m3	<0.688 U	26.1	<2.15 U	<0.688 U	<3.44 U
Dibromochloromethane	124-48-1	ug/m3	<1.7 U	<1.76 U	<5.32 U	<1.7 U	<8.52 U
Dichlorodifluoromethane	75-71-8	ug/m3	2.68	1.59	<3.09 U	2.66	<4.94 U
Ethanol	64-17-5	ug/m3	<9.42 U	24.3	<29.4 U	27.9	<47.1 U
Ethyl Acetate	141-78-6	ug/m3	<1.8 U	<1.86 U	<5.62 U	<1.8 U	<9.01 U
Ethylbenzene	100-41-4	ug/m3	<0.869 U	1.41	<2.71 U	<0.869 U	<4.34 U
Hexachlorobutadiene	87-68-3	ug/m3	<2.13 U	<2.21 U	<6.67 U	<2.13 U	<10.7 U
Isopropanol	67-63-0	ug/m3	2.61	9.51	<7.67 U	10.9	13.1
M,P-Xylene	179601-23-1	ug/m3	<1.74 U	4	<5.43 U	<1.74 U	<8.69 U
Methyl Ethyl Ketone (2-Butanone)	78-93-3	ug/m3	<1.47 U	956	1,900	2,470	1,890
Methyl Isobutyl Ketone (4-Methyl-2-Pentanone)	108-10-1	ug/m3	<2.05 U	<2.12 U	<6.39 U	<2.05 U	<10.2 U
Methylene Chloride	75-09-2	ug/m3	<1.74 U	<1.8 U	<5.42 U	<1.74 U	<8.69 U
Naphthalene	91-20-3	ug/m3	<0.996 U	<1.03 U	<3.11 U	<0.996 U	<4.98 U
n-Heptane	142-82-5	ug/m3	<0.82 U	55.7	16	15	16.9
n-Hexane	110-54-3	ug/m3	<0.705 U	84.2	12.3	13	16.1
o-Xylene (1,2-Dimethylbenzene)	95-47-6	ug/m3	<0.869 U	3	<2.71 U	<0.869 U	<4.34 U
Styrene	100-42-5	ug/m3	<0.852 U	<0.881 U	<2.66 U	<0.852 U	<4.26 U
Tert-Butyl Alcohol	75-65-0	ug/m3	<1.52 U	5.55	5.82	6.73	<7.58 U
Tert-Butyl Methyl Ether (MTBE)	1634-04-4	ug/m3	<0.721 U	<0.746 U	<2.25 U	<0.721 U	<3.61 U
Tetrachloroethene (PCE)	127-18-4	ug/m3	<1.36 U	<1.4 U	<4.24 U	<1.36 U	<6.78 U
Tetrahydrofuran	109-99-9	ug/m3	<1.47 U	<1.52 U	<4.6 U	<1.47 U	<7.37 U
Toluene	108-88-3	ug/m3	<0.754 U	7.16	<2.36 U	1.79	<3.77 U
Total Xylenes	1330-20-7	ug/m3	<0.869 U	6.99	<2.71 U	<0.869 U	<4.34 U
Trans-1,2-Dichloroethene	156-60-5	ug/m3	<0.793 U	<0.821 U	<2.48 U	<0.793 U	<3.96 U
Trans-1,3-Dichloropropene	10061-02-6	ug/m3	<0.908 U	<0.94 U	<2.84 U	<0.908 U	<4.54 U
Trichloroethene (TCE)	79-01-6	ug/m3	<1.07 U	<1.11 U	<3.36 U	<1.07 U	<5.37 U
Trichlorofluoromethane	75-69-4	ug/m3	1.38	<1.16 U	59	115	13.7
Vinyl Chloride	75-01-4	ug/m3	<0.511 U	<0.529 U	<1.6 U	<0.511 U	<2.56 U
Total BTEX	BTEX	ug/m3	ND	22.41	ND	3.18	ND
Total VOCs	TOTALVOCS	ug/m3	12.84	1801.461	2757.34	3448.89	2747.36

Table 4
Phase II Environmental Site Assessment Report
Soil Vapor Sample Analytical Results

East Adams Redevelopment - Phase VI Area
Syracuse, New York
Langan Project No.: 170859701

Notes:

AA - Ambient Air
SV - Soil Vapor
CAS - Chemical Abstract Service
NS - No standard
ug/m3 - microgram per cubic meter
NA - Not analyzed
RL - Reporting limit
<RL - Not detected
Ambient air sample analytical results are shown for reference only.

Qualifiers:

U - The analyte was analyzed for, but was not detected at a level greater than or equal to the RL; the value shown in the table is the RL.

APPENDIX A

PREVIOUS ENVIRONMENTAL REPORTS

PHASE I ENVIRONMENTAL SITE ASSESSMENT

for

East Adams Redevelopment Phase VI Area
Radisson Court
Syracuse, New York

Prepared for:

McCormack Baron Salazar, Inc. (MBSDI)
100 North Broadway, Suite 100
St. Louis, Missouri 63102

Prepared by:

Langan Engineering, Environmental, Surveying,
Landscape Architecture and Geology, D.P.C.
368 Ninth Avenue, 8th Floor
New York, New York 10001

Kimberly Semon, PE
Senior Project Manager

Brian Gochenaur, QEP
Associate Principal

Report Date: **30 October 2025**
180-Day Viability Date: **20 December 2025**
170859701

LANGAN

TABLE OF CONTENTS

EXECUTIVE SUMMARY i

1. Introduction 1

PURPOSE 1

SCOPE OF SERVICES 1

USER RESPONSIBILITIES 3

1.1 LIMITING CONDITIONS/DEVIATIONS 4

1.2 DATA GAPS 4

2. 1.3 **Subject Property Description and Current Use** **5**

1.4

1.5 LOCATION, LEGAL DESCRIPTION, AND OWNERSHIP 5

PHYSICAL SETTING 5

2.1 SUBJECT PROPERTY DESCRIPTION 6

2.2

2.3 CURRENT SUBJECT PROPERTY USE 7

2.4 HAZARDOUS SUBSTANCES AND PETROLEUM PRODUCTS 7

2.5 AIR EMISSIONS 8

2.6

2.7 WASTE MANAGEMENT 8

2.8 WASTEWATER 9

2.9 STORM WATER 9

3. 3.1 **Subject Property History and Records Review** **11**

3.2 HISTORICAL SUMMARY 11

3.3 REGULATORY DATABASE REVIEW 11

PRIOR REPORT REVIEW 12

4.1

4. 4.2 **Adjoining Properties and Surrounding Area** **13**

4.3 CURRENT USE OF ADJOINING PROPERTIES AND SURROUNDING AREA 13

ADJOINING PROPERTIES AND SURROUNDING AREA HISTORY 13

REGULATORY DATABASE REVIEW 14

5. Conclusions, Findings and Opinions **18**

6. 8.1 **Environmental Professional Statement** **20**

8.2

7. References **21**

8. Limitations and Definitions **22**

ASTM DEFINITIONS 22

STANDARD ENVIRONMENTAL RECORD SOURCES 25

TABLES

Table ES-1 Conclusions, Findings and Opinions

Table 2-1 Utility Providers

Table 3-1 Subject Property History

Table 4-1 Current Use of Adjoining Properties and Surrounding Area

Table 4-2 Historical Use of Adjoining Properties

Table 5-1 Conclusions, Findings and Opinions

Table 7-1 Dates of Assessment Components

APPENDICES

Appendix A Figures

- Figure 1 Subject Property Location Map
- Figure 2 Subject Property Layout
- Figure 3 Nearby Properties Map

Appendix B Agency Records and Other Reports

Appendix C Site Reconnaissance Checklist and Photographs

Appendix D User Provided Information

Appendix E Historical Resources

Appendix F Environmental Database Report

Appendix G Resumes of Environmental Professionals

EXECUTIVE SUMMARY

Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C. (Langan) completed a Phase I Environmental Site Assessment (ESA) of the East Adams Redevelopment Phase VI Area located Raddison Court in Syracuse, Onondaga County, New York (the "subject property") under the written authorization of McCormack Baron Salazar, Inc. (MBSDI, "Client" and the "user").

The Phase I ESA was completed following the guidelines of ASTM International Standard Practice E1527-21 (ASTM E1527-21), the United States Environmental Protection Agency's (US EPA) All Appropriate Inquiries (AAI) Rule, and industry standard practice. The user requested this ESA as part of their environmental due diligence related to a potential transaction involving the subject property.

Subject Property Layout

The about 3.0 acre subject property is identified as the southwestern part of Onondaga County Tax Parcel ID Section 095, Block 07, Lot 01.0. The subject property is located northeast of the intersection of South Townsend Street and East Taylor Street. The subject property is improved with six, two-story residential buildings (Buildings 1, 4, 5, 6, 7, and 8) and two, three-story apartment buildings (Buildings 2 and 3). The remainder of the subject property is comprised of asphalt-paved vehicle parking areas, landscaped areas, and concrete-paved walkways. The main entrance into the subject property is accessed via Jackson Street from the north.

Subject Property Current Use

The subject property operates as a multi-family townhouse apartment complex with approximately 96 residential units, and is part of Pioneer Homes.

Subject Property History

The subject property was developed with about 30 one- and two- story residences and storefronts include a carpet weaver and tailor shop as early as 1883. By 1951, the previous buildings at the subject property were razed, and replaced with the six, present-day, two- to three-story residential buildings.

Adjoining Properties and Surrounding Area

According to aerial photographs and Sanborn maps, the adjoining properties and surrounding area were generally developed with residential and commercial properties as early as the late 1800s. A section of the Delaware, Lackawanna and Western Railroad is depicted southwest of the subject property as early as 1895 on topographic maps. The Syracuse University Steam Station was present to the south by at least 1951. Multi-unit residential developments replace many former commercial and residential properties in the surrounding area in the 1950s through 1970s.

Conclusions

Langan completed a Phase I ESA of the subject property using the scope guidelines and inherent limitations of ASTM E1527-21. Table ES-1 presents the conclusions of the Phase I ESA.

Table ES-1 Conclusions, Findings and Opinions

ASTM E1527-21 Scope Items
Recognized Environmental Conditions (RECs)/Vapor Encroachment Conditions (VECs)
Historical and Current Uses of the Southern Adjoining Property: The southern adjoining property has operated as a steam generation plant since 1926. The facility is listed as housing multiple underground storage tanks (USTs) and aboveground storage tanks (ASTS), is in the NY Spills database with multiple closed spills and listed in the Resource Conservation and Recovery Act (RCRA) generator databases for generation of hazardous waste containing ignitable waste, corrosive waste, spent halogenated solvents used in degreasing, and spent halogenated solvents intermittently over a 22 year period. Undocumented spills or releases of petroleum, solvents, or other hazardous substances associated with operations at this facility may have adversely impacted groundwater and/or soil vapor on the subject property; therefore, this facility is considered a REC.
Historical Use and Documented Contamination at the Western Surrounding Properties: Historical operations on the western surrounding properties include auto repair, a drycleaner and gasoline filling station from at least 1951 through 1961. Additionally, the property about 165 feet west and cross-gradient of the subject property was identified in NY Spills database under New York State Department of Environmental Conservation (NYSDEC) Spill No. 2400040, which was reported on 2 April 2024 after soil and groundwater impacted with benzene, toluene, ethylbenzene, and xylenes (BTEX) were identified during a subsurface investigation. According to the spill listing, contamination is likely associated with the former gasoline filling station operations, about 150 feet cross-gradient from the subject property. Cleanup is pending, and the spill remains open. The historical use and documented impacts on the western surrounding properties may have impacted soil vapor at the subject property and this listing is therefore considered a VEC.
Controlled Recognized Environmental Conditions (CRECs)
Langan did not identify CRECs.
Historical Recognized Environmental Conditions (HRECs)
Historical Release: The subject property was identified in the New York Spills database as the location of a reported gasoline release in September 2020 (Spill No. 2005041). About 10 gallons of gasoline spilled from a vehicle into the parking lot. The Syracuse Fire Department responded to the release by using absorbent material to clean the spill area. The release was subsequently remediated to the satisfaction of the NYSDEC, and the spill number was closed on 13 May 2022. Based on the regulatory closure of this incident, this release is a HREC.
De Minimis Conditions
Pavement Staining: Langan observed staining on the asphalt surface of the parking lot during site reconnaissance. The asphalt was observed to be in generally good condition with no observed cracking and staining was limited in extent. Therefore, the staining is considered a de minimis condition.
Significant Data Gaps
Langan did not identify significant data gaps.
Non-ASTM E1527-21 Scope Items

ASTM E1527-21 Scope Items
Asbestos Containing Material (ACM), Lead Based Paint (LBP) and Polychlorinated Biphenyls (PCB),
Based on the age of the buildings at the subject property (circa 1940s), it is likely that ACM and LBP- and PCB-containing building material may be present. No hazardous materials survey or sampling was conducted as part of this Phase I ESA; however, a comprehensive survey of these materials conducted by a licensed professional will be completed in accordance with United States Environmental Protection Agency (USEPA) National Emission Standards for Hazardous Air Pollutants (NESHAP) (40 CFR 61, Subpart M), and United States Housing and Urban Development (HUD) guidance.
Mold
In accordance with HUD requirements, the subject property was visually assessed for indications of mold or moisture-related conditions during the site reconnaissance. The assessment was limited to readily accessible and visible interior areas; no destructive sampling or air testing was conducted. Suspect mold was not identified at the subject property during the site reconnaissance. Further assessment, if required, should be completed by a qualified mold remediation professional.
Radon
According to the USEPA Radon Zone Map, the subject property is located in Zone 1, which indicates a predicted average indoor radon screening level greater than 4 pico Curies per liter (pCi/L). According to the New York State Department of Health (NYSDOH) database of local and county radon testing results, 476 homes were tested in Onondaga County with average concentrations of 3.0 pCi/L and 1.76 pCi/L in basements and living areas, respectively. Based on this information, there is potential for elevated levels of radon gas in on-site buildings at the subject property. Mitigation measures (e.g., radon mitigation system) should be considered as part of redevelopment beneath future structures.
Business Environmental Risks (BERs)
Fill Material: According to the U.S. Department of Agriculture's (USDA) data for Onondaga County, the subject property is likely underlain by a layer of non-native fill. Non-native fill found in urban environments typically contains ash, demolition debris, and/or municipal waste products and may contain contaminants (e.g., semi volatile organic compounds [SVOCs] or metals) at concentrations above applicable regulatory standards. The occurrence of historic fill does not trigger any regulatory obligations or reporting requirements but may require remedial measures to prevent exposure to property occupants and may require implementation of soil handling and management procedures during site redevelopment to address excavation, re-use, handling, and off-site disposal. Appropriate soil handling and management procedures will be implemented during site redevelopment to address human exposure, excavation, re-use, handling, and off-site disposal..

1. INTRODUCTION

Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C. (Langan) completed a Phase I Environmental Site Assessment (ESA) of the East Adams Redevelopment Phase VI Area located at Raddison Court in Syracuse, Onondaga County, New York (the "subject property") under the written authorization of McCormack Baron Salazar, Inc. (MBSDI, "Client" and the "user"). A Subject Property Location Map is provided in Appendix A (Figure 1).

The Phase I ESA was completed following the guidelines of ASTM International Standard Practice E1527-21 (ASTM E1527-21), the United States Environmental Protection Agency's (US EPA) All Appropriate Inquiries (AAI) Rule, and industry standard practice. The user requested this ESA as part of their environmental due diligence associated with a potential transaction involving the subject property.

Purpose

1.1 The purpose of this Phase I ESA is to identify recognized environmental conditions (REC) associated with the subject property. This purpose also includes identifying controlled recognized environmental conditions (CREC), historical recognized environmental conditions (HREC), de minimis conditions, and significant data gaps. The definitions of REC, CREC, HREC, de minimis condition and other select ASTM terms used in this report are in Section 8.

Scope of Services

1.2 Langan's scope of services consisted of the completion of a Phase I ESA following the guidelines of ASTM E1527-21. Langan's scope of services as it pertains to the elements of a Phase I ESA as specified in ASTM E1527-21 is described below.

On 8 July 2024, the US EPA final rule designating two per- and polyfluoroalkyl substances (PFAS) – perfluorooctanoic acid (PFOA) and perfluorooctanesulfonic acid (PFOS) including their salts and structural isomers – as hazardous substances under the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) became effective. Because of the complex and varied historical use of PFAS in various industries; limited prior disclosures of PFAS content on product specification sheets, Material Safety Data Sheets (MSDS), and Safety Data Sheets (SDS); the complex chemistry and chemical transformations associated with some PFAS; and the ever-growing and varied list of state regulations, it is not feasible to evaluate PFOA and PFOS without also considering other PFAS. As such, absent analytical data, Langan incorporated a review of PFAS as a general class into this Phase I ESA.

PFAS and other CERCLA hazardous substances and petroleum products have been detected in background environmental samples across the globe, including in areas removed from specific recognized sources. This Phase I ESA was not intended to evaluate background concentrations of CERCLA hazardous substances or petroleum products, regardless of whether the source is naturally occurring or anthropogenic. The objective of Langan's scope of services was to identify the presence, likely presence, and/or material threat of a release of CERCLA hazardous substances and petroleum products related to specific property uses that are generally recognized as known or potential sources of such substances and products.

1.2.1 Records Review and Local Government Interviews

Langan contracted a third-party provider to search environmental regulatory databases and provide historical records. The database search included select federal, state, local and tribal standard source environmental databases within the approximate search radii specified by ASTM E1527-21.

Langan submitted Freedom of Information Act (FOIA) requests to supplement environmental database listing information. The FOIA requests were submitted to the New York State Department of Environmental Conservation (NYSDEC), New York State Department of Health (NYSDOH), and the City of Syracuse. Langan also reviewed online records including the DECinfo Locator database, NYSDEC Spill Incidents, NYSDEC Environmental Site Remediation Database, NYSDEC Bulk Storage, United States Geological Survey (USGS) mapping, and US EPA databases. Agency FOIA-requested information, where received, is discussed in relevant sections of this report and referenced in Section 7. Pertinent documents are provided in Appendix B.

Langan supplemented the third-party-provided historical records with review of online historical record sources including Google Earth Pro and NETR Online.

1.2.2 Site Reconnaissance and Owner/Operator/Occupant Interviews

Langan completed the site reconnaissance on 24 June 2025. Anikka (maintenance worker with the Syracuse Housing Authority [SHA]; the "key site manager") accompanied Olivia Miller of Langan during the site reconnaissance. Ms. Hayward has been associated with the subject property since 2023.

Langan walked the periphery of the subject property, observed the subject property from adjoining public thoroughfares, and walked the accessible interiors of structures at the subject property. Langan observed the adjoining properties and the surrounding area from the periphery of the subject property and from public thoroughfares adjoining to or traveled on to access the subject property. The weather at the time of the site reconnaissance was about 89°F and sunny. Photographs from the site reconnaissance are provided in Appendix C.

Langan interviewed Ms. Hayward during the site reconnaissance. A telephone interview was also completed with Lindy Madill (Development Director of SHA), the owner of the subject property, on 15 August 2025. The key site manager was not aware of any environmental documents pertaining to the subject property, other than the documents provided in Section 3.3 of this report. The key site manager stated that, to her knowledge, there were no pending, threatened, or past litigation or administrative proceedings relevant to hazardous substances or petroleum products in, on, at, or from the subject property, and that she was not aware of any notices from any governmental entity regarding any possible violation of environmental laws or possible liability relating to hazardous substances of petroleum products. Other relevant information from the interview is included in this report.

1.2.3 Evaluation, Report and Parts Used in Concert

Langan evaluated the information obtained from the records reviews, site reconnaissance and interviews described above, and from the user as described in Section 1.3 in concert with each other. Langan's findings, opinions, and conclusions are discussed throughout this report. Significant assumptions, or deletions, deviations or exceptions to ASTM E1527-21 are noted in Section 1.4.

Non-ASTM Scope of Services

Langan evaluated the following Non-ASTM Scope Services as part of this Phase I ESA in accordance with the United States Department of Housing and Urban Development (HUD) guidance: asbestos-containing material (ACM), lead-based paint (LBP), polychlorinated biphenyls (PCBs), mold, and radon. Findings are further described in Section 2.10.

1.3

Vapor Encroachment Screening

Langan completed a limited vapor encroachment screening for potential vapor encroachment conditions (VEC), in general conformance with ASTM E2600-15 Standard Guide for Vapor Encroachment Screening, which may affect the subject property. The VEC screening focused on
1.4 the current and historical use of the subject property and utilized the regulatory agency database report provided by Environmental Data Resources, Inc. (EDR) to evaluate identified chemicals of concern (ChOC). To identify the area of concern (AOC) for contaminated sites with non-petroleum hydrocarbon ChOCs, Langan utilized the approximate minimum search distance defined by ASTM E2600-15 of 1,760 feet (1/3 mile) from the subject property boundary for ChOC-contaminated sites. For sites contaminated with petroleum hydrocarbon ChOCs, Langan utilized the AOC approximate minimum search distance of 528 feet (1/10 mile). The AOC was adjusted accordingly based on review of physical setting characteristics, known release information, subject property land features, groundwater flow direction and soil type, et al.

ASTM's Vapor Encroachment guidance indicates that when groundwater flow direction can be estimated or determined, the cross-gradient or down-gradient radius distances can be significantly reduced. The reduced AOC distances were calculated when considering groundwater flow direction by utilizing the following default distances, which were determined using the Buonicore Methodology: (non-petroleum hydrocarbon ChOCs) 1,760 feet in the upgradient direction; 365 feet in the cross-gradient direction; and 100 feet in the downgradient direction and (petroleum hydrocarbon ChOCs) 528 feet in the upgradient direction; 165 feet in the cross-gradient direction if Light Non-Aqueous Phase Liquid (LNAPL, i.e., floating product) is suspected; 95 feet in the cross-gradient direction if no LNAPL is suspected; 100 feet in the downgradient direction (LNAPL suspected); and 30 feet in the downgradient direction (LNAPL not suspected).

1.5 VECs identified for the subject property are further discussed in Section 4.0.

User Responsibilities

Langan requested that the user provide the results of tasks the user is responsible for completing to satisfy the requirements of AAI. The tasks include: provision of information related to specialized knowledge or experience of the user or the degree of obviousness relative to conditions indicative of releases or threatened releases; actual knowledge of the user regarding environmental liens or AULs related to the subject property; specialized knowledge or experience of the user; reasons for significantly lower purchase prices, and commonly known or reasonably ascertainable information within the local community about the subject property. Langan also requested that the user state the reason the Phase I ESA was requested. A summary of the user's responses is provided in Appendix D and relevant information provided by the user is discussed in applicable sections of this report.

While typically considered a user responsibility under ASTM E1527-21 guidelines, the user requested that Langan complete a search for environmental liens and AULs as part of the

preparation of this Phase I ESA. Langan engaged Environmental Data Resources (EDR) to complete an Environmental Lien and AUL Search to 1980 on the user's behalf. The information was supplied to Langan by a vendor, and to the vendor by government sources; therefore, neither Langan nor the vendor can verify the completeness or accuracy of the title search, or AUL searches. As documented in the EDR Environmental Lien and AUL Search included in Appendix E, environmental liens and AULs were not found associated with the subject property.

Limiting Conditions/Deviations

1.6 Langan was unable to observe interior conditions within the majority of the residential spaces due to tenant occupation at the time of the site reconnaissance.. The key site manager reported that no chemical use (apart from household cleaning products) or hazardous materials are present within the residential spaces. Therefore, this limiting condition did not impact Langan's conclusions.

Langan was unable to observe the ground surface within crawlspaces beneath Building 1 and Buildings 4 through 8 at the subject property; however, select crawlspaces were inspected during a previous site visit conducted by Langan in October 2024. Langan did not observe storage of hazardous material or petroleum products in the crawlspaces during the previous site visits; however, electric-powered water pumps were observed. These pumps were noted to require frequent maintenance which consisted of adding gear oil into the pump motor housing. The inability to access the crawlspaces and inspect the water pumps during the June 2025 site reconnaissance poses a limiting condition.

Langan did not delete or deviate from the ASTM E1527-21 guidelines during this Phase I ESA.

1.7 Data Gaps

Data gaps, if encountered, are discussed throughout the report. Significant data gaps, if any, are summarized in Section 5.0.

2. SUBJECT PROPERTY DESCRIPTION AND CURRENT USE

The following sections describe the subject property location, ownership, physical setting, and current layout and operations.

Location, Legal Description, and Ownership

The about 3.0-acre subject property is identified as the southwestern part of Onondaga County Department of Planning with Tax ID Section 095, Block 12, Lot 01.0. The subject property is located northeast of the intersection of South Townsend Street and East Taylor Street. A property record card is provided in Appendix E. The subject property is owned by the SHA.

2.1

Physical Setting

The physical setting that includes the geologic, hydrogeologic, hydrologic, and topographic characteristics of the subject property and surrounding area is discussed below.

2.2

2.2.1 Topography

The 2019 USGS 7.5-minute quadrangle topographic map for Western Syracuse depicts the subject property at an elevation of about 400 feet[1] above mean sea level (amsl) with a gentle slope downward toward west. The regional topography slopes downward toward the northwest and southwest, toward Onondaga Lake and Onondaga Creek, respectively, which are located about 2.5 miles northwest and 0.5 miles southwest of the subject property, respectively.

2.2.2 Geology

According to the U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) Soil Survey Geographic (SSURGO) data for the subject property, soil at the subject property consists primarily of urban land. Urban land is described as excavated, filled, and made land. Typically, these soils have been mixed with other materials, such as brick, concrete, and demolition debris of unknown origin (non-native fill). Non-native fill found in urban environments typically contains ash, demolition debris, and/or municipal waste products and may contain contaminants (e.g., semi volatile organic compounds [SVOCs] or metals) at concentrations above current regulatory standards. Non-native fill does not trigger a regulatory reporting requirement but is a business environmental risk (BER) because it is often associated with cost premiums for handling, management, transport, and disposal

Based on review of the USGS "Geologic Map of New York, Finger Lakes Sheet (Fisher, Isachsen, Rickard, dated March 1970)", the subject property is underlain by bedrock of the Syracuse Foundation, consisting of dolostone, shale, gypsum and salt.

[1] Elevations in this report refer to North American Vertical Datum of 1988 (NAVD88), which is about 1.1 feet above mean sea level at Sandy Hook, New Jersey.

2.2.3 Hydrogeology

Surface water bodies are not present within the boundary of the subject property. The nearest major surface water bodies are Onondaga Lake and Onondaga Creek which are located about 2.5 miles northwest and 0.5 miles southwest of the subject property, respectively. Information regarding subject property-specific groundwater flow direction is unavailable. Groundwater flow can be influenced by several factors such as surface water bodies, wetlands, hydrogeologic and anthropogenic variables. However, based on topographic gradient and proximity to Onondaga Creek, it is expected that groundwater generally flows to the southwest.

A review of the Geocheck section of the LightBox Environmental Data Resources (EDR) Regulatory Database Report (Appendix F) and site reconnaissance observations did not identify groundwater wells on the subject property. No oil and gas wells were identified within a 1-mile radius of the subject property.

2.3 Subject Property Description

The subject property is located within the southwestern part of the Pioneer Homes development and is improved with six, two-story residential buildings (Building 1 and Buildings 4 through 8) and two, three-story apartment buildings (Buildings 2 and 3). Each two-story residential building is constructed over vented crawlspaces with poured concrete or concrete masonry foundation walls and dirt floors. Both three-story apartment buildings are constructed with full basements consisting of poured concrete foundation walls and concrete floors.

The remainder of the subject property is comprised of asphalt-paved parking areas, landscaped areas, and concrete-paved walkways. The main entrances into the subject property are accessed via Jackson Street from the north.

Residential buildings within the Pioneer Homes housing development consist entirely of living space. Building heat and domestic hot water (DHW) are provided by four natural gas-fired boilers within the basement boiler room of Building 3. Apartment cooling is provided by tenant-supplied electric-powered window air conditioning units. Ventilation is provided by a through-wall kitchen exhaust fan in every apartment and a bathroom exhaust fan in each family unit.

High-voltage electric supply is delivered to the Pioneer Homes development via National Grid's primary underground network. Electricity is routed from this network to the main high voltage switchgear room located on the southern exterior of Building 3. Electric routes within the subject property to individual low voltage (480-volt to 120/240-volt) 3-phase outdoor step-down transformers are located on the exterior of Building 1 and Buildings 4 through 8.

According to the Rezone Syracuse ordinance and City of Syracuse Zoning Map, the subject property is located within an MX-2: Neighborhood Center District. The MX-2: Neighborhood Center zoning district is generally characterized as pedestrian-friendly, transit-supportive areas of medium density residential development and a well-integrated mix of non-residential uses. The surrounding properties are zoned for MX-2: Neighborhood Center Districts, MX-5: Central Business Districts, LI: Light Industry and Employment Districts, and OS: Open Space Districts. A copy of the zoning map is included in Appendix B.

A Subject Property Layout Map is provided in Figure 2 of Appendix A. Photographs of the subject property and a checklist documenting Langan's observations relative to the features, activities, uses and conditions outlined in Section 9.4 of ASTM E1527-21 are in Appendix C.

Current Subject Property Use

The subject property operates as a multi-family townhouse apartment complex with approximately 96 residential units, and is part of Pioneer Homes.

The following table summarizes subject property utility providers.

2.4 **Table 2-1 Utility Providers**

Utility	Providers
Electricity	National Grid
Natural gas	National Grid
Water	City of Syracuse
Sewer	Onondaga County

Hazardous Substances and Petroleum Products

2.5 With the exception of the limited quantities of janitorial products observed within select tenant spaces, Langan did not observe chemical storage at the subject property at the subject property. Langan did not observe evidence of leaks, spills, pools of liquid or releases such as staining, or sheens, other than as described below.

2.5.1 Underground Storage Tanks (USTs)

Langan did not observe USTs or fill ports indicating the presence of a UST at the subject property. The Pioneer Homes apartment complex is registered as a closed/unregulated Petroleum Bulk Storage (PBS) facility (No. 7-498947) and was registered for two closed-removed No. 2 fuel oil USTs: a 5,000-gallon No. 2 fuel oil UST installed in 1984 and removed in 1994, and a 10,000-gallon No. 2 fuel oil UST installed in 1984 and removed in 1993. Records obtained through a FOIA request to the NYSDEC showed that these USTs were located at other areas of the Pioneer Homes apartment complex (Buildings 18 and 38), and were not located on the subject property. No releases were documented.

2.5.2 Aboveground Storage Tanks (ASTs)

The EDR database report did not identify ASTs at the subject property, and Langan did not observe evidence of ASTs at the subject property. The subject property, the Pioneer Homes apartment complex, was identified as a Petroleum Bulk Storage (PBS) facility, under PBS No. 7-498947 for two closed-removed 2,500-gallon No. 2 fuel oil ASTs; however, these were located at other areas of the Pioneer Homes apartment complex, per records obtained through an information request to the NYSDEC.

2.5.3 Drums, Totes, and Intermediate Bulk Containers

Langan did not observe drums, totes, or other intermediate bulk containers at the subject property.

2.5.4 Other Chemical Storage, Containers, or Equipment

Langan observed the following fluid-containing equipment:

- A high-voltage, pad-mounted electrical transformer located within a fenced-in area on the southern exterior of Building 3.
- An electrical transformer located within the basement of Building 3, and two electrical transformers located within the basement of Building 2.
- Six low-voltage pad-mounted transformers located on the exteriors of Building 1 and Buildings 4 through 8; transformer locations are shown on Figure 2.

Langan did not observe evidence of staining or releases associated with the transformers.

Langan observed several retail-sized maintenance products and cleaning supplies in the basement of Building 2. The products were labeled and appeared in good condition, with no open containers or evidence of leaks.

Langan observed staining on the asphalt surface of the parking lot during site reconnaissance. The asphalt was observed to be in generally good condition with no observed cracking and staining was limited in extent. Asphalt staining is a de minimis condition.

Langan was unable to observe the ground surface within crawlspaces beneath Building 1 and Buildings 4 through 8; however, select crawlspaces were observed during Langan's site visit in October 2024. Langan did not observe storage of hazardous material or petroleum products in the crawlspaces; however, electric-powered water pumps were observed during the October 2024 site visit. These pumps were noted to require frequent maintenance which consists of adding gear oil through the pump motor housing. The inability to access the crawlspaces and inspect the water pumps poses a limiting condition.

2.6 Air Emissions

Air emission sources at the subject property consist of natural gas-fired heating appliances. Langan did not identify obvious impacts, such as visible emissions or odors, from air emission sources at the subject property.

2.7 Langan does not consider the air emissions an environmental concern for the subject property.

Waste Management

The following sections describe current hazardous and non-hazardous waste streams, and observations of fill areas or other solid waste throughout the subject property.

2.7.1 Hazardous Waste

Langan did not observe any indication of hazardous waste generation at the subject property.

2.7.2 Non-Hazardous Waste

Non-hazardous waste generated at the subject property consists of general tenant refuse. Bins containing general refuse were observed throughout interior tenant spaces. Non-hazardous waste is deposited into two solid-waste dumpsters located within the asphalt-paved parking lot within the southern portion of the subject property for pick up by a local disposal company on a regular basis. Non-hazardous waste containers appeared to be intact without obvious indications of a release or material threat of a future release.

Langan observed a former incinerator in the basement of Building 3. The incinerator was formerly used for trash disposal at the subject property.

2.7.3 Fill Areas or Solid Waste

Langan did not observe areas that were apparently filled or graded by non-natural causes (or filled with material of unknown origin) that suggest the presence of garbage, construction debris, demolition debris, or other solid waste disposal, or mounds or depressions suggesting solid waste disposal.

Wastewater

Sanitary wastewater is discharged to the city municipal sanitary sewer system. Floor drains were observed throughout basements and/or crawlspaces beneath the apartment buildings. A sump was observed within the basement boiler room of Building 3. No sheen, odors, or other evidence
2.8 of a release were observed in the vicinity of the drains or sump.

Pooled water was observed near the ejectors pit within the boiler room. Langan also observed apparent water staining and infiltration on the walls and floors of the pump room in Building 3. No sheen or odors were observed in these areas.

Langan did not observe or identify evidence of septic systems or cesspools at the subject property.

Storm Water

2.9 Storm water at the subject property percolates through pervious areas or sheet flows to the adjoining roadways into the municipal storm sewer system. Storm drains were observed within the exterior areas throughout the subject property. According to the key site manager, all storm drains connect to the municipal storm sewer system. Langan did not observe evidence of impact (e.g., sheens, staining) to storm water pathways.

2.10

Non-ASTM Considerations

2.10.1 ACM, LBP, and PCBs

Based on the age of the buildings at the subject property (circa 1940s), it is likely that ACM-containing materials (i.e., roof tiles, mastic, pipe wrap, floor tile, etc.), LBP and PCB-containing materials (i.e., caulk) may be present. Pad-mounted transformers were identified on the subject property (See Section 2.5); however, PCB-containing transformers have generally been phased out of service beginning in the mid-1980s,and are not likely to be present at the subject property. No hazardous materials survey or sampling was conducted as part of this Phase I ESA; however, a comprehensive survey of these materials conducted by a licensed professional will be completed in accordance with United States Environmental Protection Agency (USEPA) National Emission Standards for Hazardous Air Pollutants (NESHAP) (40 CFR 61, Subpart M), and HUD guidance prior to demolition of structures for redevelopment.

2.10.2 Mold

In accordance with HUD requirements, the subject property was visually assessed for indications of mold or moisture-related conditions during the site reconnaissance. The assessment was limited to readily accessible and visible interior areas; no destructive sampling or air testing was conducted. Suspect mold was not identified at the subject property during the site reconnaissance. Further assessment, if required, should be completed by a qualified mold remediation professional.

2.10.3 Radon

Radon is a colorless, odorless radioactive gas that results from the natural breakdown of uranium minerals in soil, rock, and water, which subsequently enters the atmosphere. It can concentrate in buildings, entering through cracks and other penetrations of a building foundation. Some areas are more likely to have elevated concentrations of radon than others, reflecting subsurface lithological conditions.

The USEPA has established a recommended radon action level of 4.0 pico Curies per liter (pCi/L). According to the USEPA Radon Zone Map, the subject property is located in Zone 1, which indicates a predicted average indoor radon screening level greater than 4 pCi/L. The NYSDOH maintains a database of radon test results on a local and county level. According to the database, 476 homes were tested in Onondaga County with average concentrations of 3.0 pCi/L and 1.76 pCi/L in basements and living areas, respectively. A total of 62% of basements and 76% of living areas had concentrations below 4 pCi/L. Based on this information, there is potential for elevated levels of radon gas in on-site buildings at the subject property. Mitigation measures (e.g., radon mitigation system) should be considered as part of redevelopment beneath future structures.

3. SUBJECT PROPERTY HISTORY AND RECORDS REVIEW

The following sections provide summaries of the historical uses of the subject property, and available information regarding documented environmental conditions associated with the historical uses.

Historical Summary

Langan compiled the following summary of the subject property history based on a review of readily available and reasonably ascertainable sources and interviews. Historical resources are provided in Appendix E.

3.1

Table 3-1 Subject Property History

Time Period	Historical Discussion
1890 – 1930s	An 1892 Sanborn map depicts the subject property with about 30 one- to two-story residential buildings and several commercial spaces, including a tailor and carpet weaver. Jackson Street is depicted as bisecting the subject property in an east-west orientation in 1892. By 1910, a steam fitters' facility is depicted at the center of the subject property. Demolition of previous structures ahead of redevelopment is apparent in a 1938 aerial photograph.
1930s - present	By 1951, the previous buildings are no longer present, and six, two- to three-story residential buildings are constructed on the property (Sanborn maps). Radisson Court is also depicted on the subject property, with a vehicle turnaround at the center of the property. The subject property appears in a similar configuration through present day. According to the Onondaga County Department of Finance Database, Syracuse Housing Authority purchased the subject property in 1993. The subject property is zoned as a Neighborhood Center (MX-2).

Historical information was not readily available to characterize the subject property prior to 1892. The 1892 Sanborn map indicates the subject property was already developed with residential and commercial structures, and earlier historical resources identifying the use of the subject property were not available. It is unlikely that the use of the subject property varied greatly from that depicted in 1892, and the data gap is not considered significant.

3.2

Environmental concerns related to historical operations are discussed further in Section 3.2.

Regulatory Database Review

The subject property is identified on the Resource Conservation and Recovery Act (RCRA), Environmental Compliance and History Online (ECHO), Facility Index System (FINDS), Manifest, and NY Spills databases.

The facility was listed on the RCRA database as a small quantity generator (SQG) of corrosive waste (D002) in 2008 and 2015. According to the ECHO database, no violations were reported. The FINDS database is centrally managed and identifies facilities subject to environmental regulations. The facility is listed on the FINDS database, with Registry ID 110033157232, related to hazardous waste generation. The facility is also listed in the Manifest database with EPA ID NYR000154476 and is associated with the RCRA listing for the transport of hazardous waste generated from the site in 2008 and 2015.

The subject property was identified in the New York Spills database under NYSDEC Spill No. 2005041. The incident was reported on 1 September 2020 after the release of about 10 gallons of gasoline from a vehicle into a parking spot. The Syracuse Fire Department responded to the release by using absorbent material to clean the spill area. The release was subsequently remediated to the satisfaction of the NYSDEC, and the spill number was closed on 13 May 2022. Based on the regulatory closure of this incident, this release is a HREC.

Prior Report Review

Langan was not provided with prior reports for review.

3.3

4. ADJOINING PROPERTIES AND SURROUNDING AREA

The following sections describe current and historical uses of and database listings for adjoining properties and the surrounding area.

Current Use of Adjoining Properties and Surrounding Area

The current use of adjoining and surrounding properties is summarized in Table 4-1.

Table 4-1 Current Use of Adjoining Properties and Surrounding Area

4.1

Direction	Adjoining Properties	Surrounding Area
North	Pioneer Homes apartment complex (1001 through 1069 South Townsend Street, 100 through 139 Dablon Court, and 1000 through 1044 South McBride Street [even house numbers])	Multi-unit apartment complex
East	South McBride Street followed by a community center and Wilson Park (1101 and 1105 South McBride Street and 1117 South McBride Street)	Route 81 followed by Pioneer Homes (Gage Court)
South	East Taylor Street, followed by a wooded area and a section of the Delaware, Lackawanna and Western Railroad, and Alco Steam Plant (1202-04 South McBride Street)	Parking lots
West	Multi-unit apartment complex (100 through 124 Angelou Terrace, 200 through 301 Chavez Terrace, and 100 through 124 Latimer Terrace)	Roesler Park, fire station, and commercial properties

4.2 Langan did not observe obvious conditions likely to represent environmental concerns for the subject property from current uses of adjoining or surrounding properties.

Adjoining Properties and Surrounding Area History

Langan compiled the following summaries of the adjoining properties and surrounding area history based on a review of historical resources and interviews. Historical resources are provided in Appendix E.

Table 4-2 Historical Use of Adjoining Properties

Direction	Adjoining Properties
North	On the 1892 Sanborn map, the northern adjoining property is depicted as developed with about 30, one- to two-story residences throughout the property, and various commercial operations on the southern part of the property including a carpenter and tailor shop. The property is further developed with residential buildings through 1910, including apartment buildings and tenement housing. By 1951, a multi-unit apartment complex replaces the former structures, as seen in aerial photographs. According to the Onondaga County Tax Assessor records, the property was purchased by Pioneer Homes in 1993. The northern adjoining property remains relatively the same through present day. Langan does not consider the historical use of the northern adjoining property an environmental concern for the subject property.

Direction	Adjoining Properties
East	On the 1892 Sanborn map, the eastern adjoining property is depicted as developed with residential buildings. Redevelopment evidenced by demolition of previous structures is apparent in a 1938 aerial photograph. By 1951, the present-day community center building is constructed, as well as two swimming pools and a bath house. By 1978, the former swimming pools and bath house are replaced with the present-day swimming pool and bath house on the south-central part of the property (aerial photographs). By 1995, the present-day playground and basketball courts on the northern portion of the property are apparent in aerial photographs. The eastern adjoining property remains relatively the same through present day. Langan does not consider the historical use of the eastern adjoining property an environmental concern for the subject property.
South	On the 1892 Sanborn map, the southern adjoining property is developed with residential properties, a coal and wood yard, and a portion of the Delaware, Lackawanna and Western Railroad. According to the Syracuse University Library Database, the steam plant was constructed in 1926. The railroad and a steam plant are visible as early as 1938 in aerial photographs. The steam plant is identified on the Sanborn maps beginning in 1951 as the Syracuse University Steam Station, later identified as the Alco Steam Plant (Sanborn maps). The southern adjoining property remains relatively the same through at least 2015. This property is further discussed further in Section 4.3.1.
West	Sanborn maps depict the western adjoining property with several one- to three-story residential buildings and a church in 1892. By 1951, the church on the northwestern corner the property is replaced by a storefront (Sanborn maps). Between 1968 and 1988, the previous structures are razed and the property is redeveloped with several residential buildings. By 1990, these buildings are demolished and the property is redeveloped with the present day apartment complexes at Angelou Terrace, Chavez Terrace, and Latimer Terrace (aerial photographs). The subject property appears relatively unchanged through present day. This property is further discussed in Section 4.3.1.

The surrounding has been depicted as developed with residential and commercial properties since the late 1890s, according to topographic and Sanborn maps. Historical uses of the surrounding properties include a railway (1895 to present), metal tool manufacturing facility (1892 to 1971), a dry cleaner (1951 to 1961), a gas station (1951 to 1961), and an auto repair shop (from at least 1951 to 1966). By 1951, surrounding properties to the north, east and northwest are redeveloped into residential apartment complexes; this development continues and expands through the mid-1990s. The Riley Steam Plant was constructed southeast of the subject property by 1952 as an augment to the 1926-constructed Alco Steam Plant (Syracuse University Library Database). By 1966, Interstate 81 is present in aerial photographs east of the subject property. The surrounding area appears to be in a similar configuration from 1995 through present day. Database listings associated with the surrounding area are discussed in Section 4.3.

4.3

Regulatory Database Review

Langan reviewed the environmental database report to evaluate if adjoining or surrounding area properties identified in the database report are suspected to represent an environmental concern for the subject property (see Section 8.2). Langan did not consider request and review of the

associated regulatory agency files necessary to evaluate potential RECs for the subject property unless discussed in Section 4.3.1 or 4.3.2 below.

4.3.1 Adjoining Properties

Database listings for adjoining properties are summarized as follows.

Onondaga Plaza – Lincoln Center (western adjoining, inferred cross- and down-gradient)

This facility was identified in the NY Spills database. An unreported amount of dust and debris was released to air as a result of façade removal from a building in August 1994 (Spill Number 9405994). The spill was closed in August 1994. Based on the lack of a release to the subsurface, and the closure of the release, this listing is not considered a REC.

NY1-1 Pioneer Homes – Adams/Renwick/Taylor/State (western adjoining, inferred down-gradient)

This facility was identified in the UST database. One 5,000-gallon No. 2 fuel oil UST and one 10,000-gallon No. 2 fuel oil UST were identified at the facility. Both tanks were installed in 1984 and closed and removed in 1994 and 1993, respectively. Due to the closure status of the USTs and lack of reported releases, this facility is not considered a REC.

Syracuse University Steam Station/Steam Plant/Intersection of East Taylor/South McBride – 1202-04 McBride Street South (southern adjoining, inferred cross-gradient)

This facility was identified on the RCRA, Manifest, UST Finder, UST, AST, Chemical Bulk Storage (CBS) AST, Aeromatic Information Retrieval System (AIRS), Leaking Tanks, and NY Spills databases.

The facility was listed on the RCRA database as a small quantity generator in 1987, a large quantity generator in 1992, and a very small quantity generator in 2006, 2007, and 2018. The facility was listed as not a generator in 2019. Hazardous waste generated at the facility includes ignitable waste (D001), corrosive waste (D002), spent halogenated solvents used in degreasing (F001), and spent halogenated solvents (F002). The NAICS code associated with the facility is colleges, universities, and professional schools (61131). No violations were reported. The facility is also listed in the Manifest database with EPA ID NYD982271918 and is associated with the RCRA listing for the transport of hazardous waste generated at the site.

The facility is on the UST and UST Finder databases, and, according to the listing, the facility has four, 30,000-gallon #2 fuel oil USTs that are currently in service. In addition, three, 30,000-gallon #2 fuel oil USTs historically operated at the facility and are currently closed.

According to the AST database, the facility has one, 275-gallon #2 fuel oil AST and one, 300-gallon #1 fuel oil AST. According to the CBS AST database, the facility has one, 1,000-gallon methane AST, one, 1,500-gallon sulfuric acid AST, and two, 1,000-gallon ethylenediamine tetra-acetic acid (EDTA) ASTs that are currently in service.

According to the AIRS database, a permit was issued to the facility on 3 February 2012 and expired on 2 February 2012.

The following NY Spill Numbers are associated with the facility: 9908800, 0600689, 8801654, 9204042, 9107234, 1502394, 1810736, and 8605131. Product releases include #2 fuel oil, hydraulic oil, polychlorinated biphenyl (PCB) oil, and phosphoric acid. The releases were caused by tank failures, tank test failures, equipment failure, human error, and the collapse of a building.

Spill Numbers 8910992 and 8801654 note impacts to groundwater. Each spill incident has been granted closed status by the NYSDEC, indicating that NYSDEC is satisfied with spill remediation; however, based on the frequency of releases from the facility, variety of products released, and causes of releases, residual contamination or unknown releases may have impacted subsurface conditions at the subject property.

Documented and undocumented spills or releases of petroleum products, chemicals, or other hazardous substances associated with this adjoining property may have adversely affected groundwater, and/or soil vapor on the subject property; therefore, this site is a REC.

4.3.2 Surrounding Area

Langan evaluated each of the database listings for surrounding area properties (see Section 8.2). Those warranting further discussion in the context of potential to represent an environmental concern for the subject property are discussed below.

City Owned Apartment Complex – 301-311 East Taylor Street (about 150 feet northwest, inferred cross-gradient)

The property was listed in the NY Spills and Leaking Tanks (LTANKS) databases. NYSDEC Spill No. 92058359 was reported on 10 October 1992 when a leaking 500 gallon tank was identified during excavation for a new sewer line. Petroleum-impacted soil was excavated and staged for disposal, and the spill was closed on 26 January 1993. NYSDEC Spill No. 2400040, reported on 2 April 2024 when impacted soil and groundwater was observed during a Phase II investigation. The listing indicated that impacts included benzene, toluene, ethylbenzene, and xylenes (BTEX) compounds and were likely associated with the former use of the property as a gasoline station in the 1950s. Cleanup is pending at the property and the spill remains open. Based on the facility's cross- and down-gradient location with respect to the subject property, soil vapor at the subject property may be adversely impacted. Therefore, the open spill incident is considered a VEC.

McKinney Property – 1226 McBride Street (about 225 feet south, inferred down- and cross-gradient)

This facility was identified on the NY Spills, Emergency Response Program (ERP), Engineering Controls, and Institutional Controls (EC/IC) database. According to the EC/IC and NYSDEC Environmental Remediation Databases, the facility was formerly occupied by a metal working company and scrap metal processing and storage facility that operated USTs, hydraulic machinery, and capacitors containing dielectric fluids. As a result of historical operations, a subsurface investigation was completed at the facility to assess soil and groundwater contamination. Contaminants of concern included SVOCs in soil and petroleum and chlorinated volatile organic compounds (VOCs) in groundwater. Remediation conducted at the facility in 2014 included excavation of SVOC-impacted soil, to the extent practicable, and placement of a one-foot cover of clean soil across the site to prevent exposure to residual soil and groundwater contamination. A Site Management Plan (SMP) was approved by NYSDEC in May 2016. ICs at the property include land and groundwater use restrictions.

The facility was also identified in the NY Spills database. Spill No. 2308014 was reported on 28 December 2023 after oil was observed accumulating in a monitoring well at the facility. According to the listing, CNS Environmental conducted weekly monitoring events following the identification of free product and reported product thickness in the well decreased. Further information was not reasonable ascertainable. Langan submitted a FOIA request to NYSDEC on

8 July 2025 in request of well monitoring information; as of the date of this report, Langan has not received responsive records. The spill incident remains open. This facility was also identified on the database under Spills No. 0402274 and 0712291, reported on 1 June 2004 and 21 February 2008, respectively. Spill No. 0402274 was reported after 'contaminated debris' was observed on the property; the spill was closed on 4 June 2004. Spill No. 0712291 was reported after free product was observed in a monitoring well; the listing indicates that the environmental consultant would be handling remediation, and the spill was subsequently closed on 10 February 2009.

According to the databases, predominant groundwater flow at the property is south/southwest. Based on the documents remediation and EC/ICs in place, and distance and cross-gradient location with respect to the subject property, this facility is not considered a REC.

<u>East Adams Redevelopment – Phase II Area/DI Pino Anthony/Salvation Army– 1105-1117 South State Street (about 511 feet southwest, inferred down-gradient)</u>

This facility was identified in the NY Brownfields database under the name 'East Adams Redevelopment – Phase II Area' and Brownfield Cleanup Program (BCP) Site No. C734163. The site was developed as early as the 1890s and was historically occupied by a carriage manufacturing and painting facility, a bridge manufacturing facility with two gasoline tanks, a clothing factory, a scrap metal yard, a gasoline station with gasoline storage tanks, a paper baling facility, and automobile repair facility. The site is also listed in the UST, UST Finder, UST Finder Release, LTANKS, and NY Spills databases. Environmental investigations conducted between 1996 and 2023 identified contaminants of concern including VOCs, semivolatile organic compounds (SVOCs) and metals in soil; VOCs, SVOCs, and total metals in groundwater; and petroleum-related VOCs in soil vapor. There is one open NY Spill associated with this site, Spill No. 2208975, reported 6 February 2023 during a Phase II for petroleum-impacted material encountered between 5 and 15 feet bgs.

The site will be remediated in accordance with a NYSDEC-approved Remedial Action Work Plan (RAWP). Based on the distance and cross-gradient location of the site with respect to the subject property; therefore, this listing does not present an environmental concern for the subject property.

5. CONCLUSIONS, FINDINGS AND OPINIONS

Langan completed a Phase I ESA consistent with the scope and limitations of ASTM E1527-21 for the East Adams Redevelopment Phase VI Area at Radisson Court in Syracuse, Onondaga County, New York. Exceptions to, or deletions from, ASTM E1527-21 are described in Section 8 of this report.

This assessment has revealed the following RECs, CRECs, HRECs, de minimis conditions, and significant data gaps in connection with the subject property as presented in Table 5-1.

Table 5-1 Conclusions, Findings and Opinions

ASTM E1527-21 Scope Items
Recognized Environmental Conditions (RECs)/Vapor Encroachment Conditions (VECs)
Historical and Current Uses of the Southern Adjoining Property: The southern adjoining property has operated as a steam generation plant since 1926. The facility is listed as housing multiple USTs and ASTs, is in the NY Spills database with multiple closed spills and listed in the RCRA generator databases for generation of hazardous waste containing ignitable waste, corrosive waste, spent halogenated solvents used in degreasing, and spent halogenated solvents intermittently over a 22 year period. Undocumented spills or releases of petroleum, solvents, or other hazardous substances associated with operations at the facility may have adversely impacted groundwater and/or soil vapor on the subject property; therefore, this facility is considered a REC.
Historical Use and Documented Contamination at the Western Surrounding Properties: Historical operations on the western surrounding properties include auto repair, a drycleaner and gasoline filling station from at least 1951 through 1961. Additionally, the property about 165 feet northwest and cross-gradient of the subject property was identified in NY Spills database under NYSDEC Spill No. 2400040, which was reported on 2 April 2024 after soil and groundwater impacted with BTEX were identified during a subsurface investigation. According to the spill listing, contamination is likely associated with the former gasoline filling station operations, about 150 cross-gradient from the subject property. Cleanup is pending, and the spill remains open. The historical use and documented impacts on the western surrounding properties may have impacted soil vapor at the subject property and is therefore considered a VEC.
Controlled Recognized Environmental Conditions (CRECs)
Langan did not identify CRECs.
Historical Recognized Environmental Conditions (HRECs)
Historical Release: The subject property was identified in the New York Spills database as the location of a reported gasoline release in September 2020 (Spill No. 2005041). About 10 gallons of gasoline spilled from a vehicle onto the parking lot. The Syracuse Fire Department responded to the release by using absorbent material to clean the spill area. The release was subsequently remediated to the satisfaction of the NYSDEC, and the spill number was closed on 13 May 2022. Based on the regulatory closure of this incident, this release is a HREC.
De Minimis Conditions
Pavement Staining: Langan observed staining on the asphalt surface of the parking lot during site reconnaissance. The asphalt was observed to be in generally good condition with no observed cracking and staining was limited in extent.
Significant Data Gaps
Langan did not identify significant data gaps.

ASTM E1527-21 Scope Items
Non-ASTM E1527-21 Scope Items
ACM, LBP, and PCBs
Based on the age of the buildings at the subject property (circa 1940s), it is likely that ACM and LBP- and PCB-containing building material may be present. No hazardous materials survey or sampling was conducted as part of this Phase I ESA; however, a comprehensive survey of these materials conducted by a licensed professional will be completed in accordance with NESHAP (40 CFR 61, Subpart M), and HUD guidance.
Mold
In accordance with HUD requirements, the subject property was visually assessed for indications of mold or moisture-related conditions during the site reconnaissance. The assessment was limited to readily accessible and visible interior areas; no destructive sampling or air testing was conducted. Suspect mold was not identified at the subject property during the site reconnaissance. Further assessment, if required, should be completed by a qualified mold remediation professional.
Radon
According to the USEPA Radon Zone Map, the subject property is located in Zone 1, which indicates a predicted average indoor radon screening level greater than 4 pCi/L. According to the NYSDOH database of local and county radon testing results, 476 homes were tested in Onondaga County with average concentrations of 3.0 pCi/L and 1.76 pCi/L in basements and living areas, respectively. Based on this information, there is potential for elevated levels of radon gas in on-site buildings at the subject property. Mitigation measures (e.g., radon mitigation system) should be considered as part of redevelopment beneath future structures.
Business Environmental Risks (BERs)
Fill Material: According to the USDA NRCS SSURGO data for Onondaga County, soils at the subject property consist primarily of urban land. Urban land is described as excavated, filled, and made land. Typically, these soils have been mixed with other materials, such as brick, concrete, and demolition debris of unknown origin (non-native fill). Demolition debris is typically present in non-native fill found in urban environments, as well as ash and/or municipal waste products. Non-native fill may contain contaminants (e.g., SVOCs or metals) at concentrations above current regulatory standards. Non-native fill does not trigger a regulatory reporting requirement but is often associated with cost premiums for handling, management, transport, and disposal, therefore the non-native fill at the subject property is a BER.

6. ENVIRONMENTAL PROFESSIONAL STATEMENT

I declare that to the best of my professional knowledge and belief, I meet the definition of Environmental Professional as defined in Section 312.10 of 40 CFR Part 312 and I have the specific qualifications based on my education, training, and experience to assess a property of the nature, history, and setting of the subject property. I have developed and performed all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

Brian Gochenaur, QEP
Associate Principal (Environmental Professional)

Resumes outlining the qualifications of the project team and the Environmental Professional are included in Appendix G.

7. REFERENCES

Langan used the following sources to complete this Phase I ESA.

- ASTM E1527-21, Standard Practice for Environmental Property Assessments: Phase I Environmental Property Assessment Process, published 16 November 2021
- EDR, Inc., Radius Map Report with GeoCheck, 23 June 2025
- EDR, Inc., City Directory Image Report, 25 June 2025
- EDR, Inc., Aerial Photographs, 23 June 2025
- EDR, Inc., Historical Topographic Map Report, 23 June 2025
- EDR, Inc., Sanborn Map Report, 23 June 2025
- Interstate Technology and Regulatory Council, Per and Polyfluoroalkyl Substances Technical and Regulatory Guidance, July 2023
- Onondaga County Department of Finance Property Search, https://onondaga.go2gov.net/faces/search.jsp
- Onondaga County GIS On The Web Parcel Viewer, https://spatial.vhb.com/onondaga/
- PFAS Exchange GIS Webviewer, https://experience.arcgis.com/experience/12412ab41b3141598e0bb48523a7c940/
- United States Census Bureau, North American Industry Classification System, https://www.census.gov/naics/
- US EPA 40 CFR Part 302 (EPA-HQ-OLEM-2019-0341; FRL-7204-03-OLEM), RIN 2050-AH09, Designation of Perfluorooctanoic Acid (PFOA) and Perfluorooctanesulfonic Acid (PFOS) as CERCLA Hazardous Substances, Final Rule, 8 May 2024
- US EPA ECHO database: http://echo.epa.gov/facilities searched 24 June 2025
- US EPA ECHO: PFAS Analytic Tools - https://echo.epa.gov/trends/pfas-tools
- US EPA ENVIROFACTS database: https://www3.epa.gov/enviro/ searched 24 June 2025
- US EPA MyProperty database: https://www3.epa.gov/enviro/facts/myproperty/ searched 24 June 2025

Table 7-1 Dates of Assessment Components

COMPONENT	DATE
Interviews	24 June 2025
Review of government records	23 June 2025
Site reconnaissance	24 June 2025
Declaration by Environmental Professional	30 October 2025

8. LIMITATIONS AND DEFINITIONS

This Phase I ESA report was prepared for Client and is intended to be used in its entirety. Excerpts taken from this report are not necessarily representative of the assessment findings. The Client is the sole intended beneficiary of the report. The user requested no special terms or conditions regarding this Phase I ESA.

Langan's scope of services, which is described in Section 1.2 and in the contract executed between Langan and the Client, was limited to that agreed to with the Client/user and no other services beyond those explicitly stated are implied. To the extent possible, the services performed and agreed upon for this Phase I ESA are consistent with the guidelines of ASTM E1527-21.

This report is not intended to be an exhaustive assessment of the subject property. The purpose of the Phase I ESA is to reduce uncertainty about unknown conditions at the subject property. No environmental site assessment can wholly eliminate uncertainty regarding the potential for RECs in connection with a subject property. Therefore, Langan cannot "verify", "insure", "certify", or "guarantee" that the subject property is free of environmental concerns.

No expressed or implied representation or warranty is included or intended in this report, except that our services were completed using the care and skill ordinarily followed by professionals providing similar services under similar circumstances in similar locations at the same point in time.

The conclusions provided in this report are based solely on information obtained through completing the standard activities required by ASTM E1527-21 and are intended exclusively for the purpose stated herein, at the specified subject property, as it existed at the point in time the assessment was completed. The conclusions provided in this report do not apply to conditions and features of which Langan was not made aware of through good faith efforts to complete the activities required by ASTM E1527-21 and did not have the opportunity to evaluate.

8.1 ASTM Definitions

The following definitions are provided in ASTM E1527-21 and presented below for reference. This section is not a comprehensive list of definitions provided in ASTM E1527-21 and is intended to summarize those pertinent to this Phase I ESA report.

Activity and use limitations (AULs): legal or physical restrictions or limitations on the use of, or access to, a site or facility: (1) to reduce or eliminate potential exposure to hazardous substances or petroleum products in the soil, soil vapor, groundwater, and/or surface water on the property, or (2) to prevent activities that could interfere with the effective-ness of a response action, in order to ensure maintenance of a condition of no significant risk to public health or the environment. These legal or physical restrictions, which may include institutional and/or engineering controls, are intended to prevent adverse impacts to individuals or populations that may be exposed to hazardous substances and petroleum products in the soil, soil vapor, groundwater, and/or surface water on a property.

Adjoining properties: any real property or properties the border of which is contiguous or partially contiguous with that of the subject property, or that would be contiguous or partially contiguous with that of the subject property but for a street, road, or other public thoroughfare separating them.

All Appropriate Inquiries: that inquiry constituting all appropriate inquiries into the previous ownership and uses of the subject property consistent with good commercial and customary practice as defined in CERCLA, 42 U.S.C.§ 9601(35)(B) and 40 C.F.R. Part 312, that will qualify a party to a commercial real estate transaction for one of the threshold criteria for satisfying the LLPs to CERCLA liability (42U.S.C. §§ 9601(35)(A) & (B), § 9607(b)(3), § 9607(q), and§ 9607(r)), assuming compliance with other elements of the defense.

Approximate minimum search distance: the area for which records must be obtained and reviewed pursuant to ASTM E1527-21 Section 8 subject to the limitations provided in that section. This may include areas outside the subject property and shall be measured from the nearest subject property boundary. This term is used in lieu of radius to include irregularly shaped properties.

Business environmental risk (BER): a risk which can have a material environmental or environmentally-driven impact on the business associated with the current or planned use of commercial real estate, not necessarily related to those environmental issues required to be investigated in this practice. Consideration of BER issues may involve addressing one or more non-scope considerations.

Controlled recognized environmental condition (CREC): recognized environmental condition affecting the subject property that has been addressed to the satisfaction of the applicable regulatory authority or authorities with hazardous substances or petroleum products allowed to remain in place subject to implementation of required controls (for example, activity and use limitations or other property use limitations).

Data gap: a lack of or inability to obtain information required by this practice despite good faith efforts by the environmental professional to gather such information. Data gaps may result from incompleteness in any of the activities required by this practice, including, but not limited to, site reconnaissance (for example, an inability to conduct the site visit), and interviews (for example, an inability to interview the key site manager, regulatory officials, etc.).

De minimis condition: a condition related to a release that generally does not present a threat to human health or the environment and that generally would not be the subject of an enforcement action if brought to the attention of appropriate governmental agencies. A condition determined to be a de minimis condition is not a recognized environmental condition nor a controlled recognized environmental condition.

Engineering controls: physical modifications to a site or facility (for example, capping, slurry walls, or point of use water treatment) to reduce or eliminate the potential for exposure to hazardous substances or petroleum products in the soil or groundwater on a property. Engineering controls are a type of activity and use limitation (AUL).

Environment: environment shall have the same meaning as the definition of environment in CERCLA 42 U.S.C. § 9601(8).

Historical recognized environmental condition (HREC): previous release of hazardous substances or petroleum products affecting the subject property that has been addressed to the satisfaction of the applicable regulatory authority or authorities and meeting unrestricted use criteria established by the applicable regulatory authority or authorities without subjecting the subject property to any controls (for example, activity and use limitations or other property use limitations). A historical recognized environmental condition is not a recognized environmental condition.

Institutional controls (IC): a legal or administrative mechanism (for example, "deed restrictions," restrictive covenants, easements, or zoning) on the use of, or access to, a site or facility to (1) reduce or eliminate potential exposure to hazardous substances or petroleum products in the soil or groundwater on the property, or (2) to prevent activities that could interfere with the effectiveness of a response action, in order to ensure maintenance of a condition of no significant risk to public health or the environment. An institutional control is a type of activity and use limitation (AUL).

Key site manager: the person identified by the owner or operator of a subject property as having good knowledge of the uses and physical characteristics of the subject property.

Material threat: obvious threat which is likely to lead to a release and that, in the opinion of the environmental professional, would likely result in impact to public health or the environment.

Obvious: that which is plain or evident; a condition or fact that could not be ignored or overlooked by a reasonable observer.

Property use limitation: limitation or restriction on current or future use of a property in connection with a response to a release, in accordance with the applicable regulatory authority or authorities that allows hazardous sub-stances or petroleum products to remain in place at concentrations exceeding unrestricted use criteria.

Reasonably ascertainable: information that is (1) publicly available, (2) obtainable from its source within reasonable time and cost constraints, and (3) practically reviewable.

Recognized environmental conditions: (1) the presence of hazardous substances or petroleum products in, on, or at the subject property due to a release to the environment; (2) the likely presence of hazardous substances or petroleum products in, on, or at the subject property due to a release or likely release to the environment; or (3) the presence of hazardous substances or petroleum products in, on, or at the subject property under conditions that pose a material threat of a future release to the environment. For the purposes of this definition, "likely" is that which is neither certain nor proved, but can be expected or believed by a reasonable observer based on the logic and/or experience of the environmental professional, and/or available evidence, as stated in the report to support the opinions given therein.

Release: a release of any hazardous substance or petroleum product shall have the same meaning as the definition of "release" in CERCLA 42 U.S.C. § 9601(22). There are a number of statutory exclusions from the definition of release that may impact the environmental professional's opinions and conclusions, such as the normal application of fertilizer.

Significant data gap: a data gap that affects the ability of the environmental professional to identify a recognized environmental condition.

Site reconnaissance: that part that is contained in Section 9 of ASTM E1527-21 and addresses what should be done in connection with the site visit. The site reconnaissance includes, but is not limited to, the site visit done in connection with such a Phase I Environmental Site Assessment.

Site visit: the visit of the subject property during which observations are made constituting the site reconnaissance section of this practice.

Subject property: the property that is the subject of the environmental site assessment described in this practice.

User: the party seeking to use ASTM E1527-21 to complete an environmental site assessment of the subject property.

Standard Environmental Record Sources

8.2 Langan reviewed an environmental database search report prepared by an environmental database search provider for the subject property and surrounding area. The database search report includes a listing of properties identified on select federal, state, local and tribal standard source environmental databases within the approximate minimum search radii outlined in ASTM E1527-21. This information was supplied to Langan by the environmental database search provider, and to the environmental database search provider by government sources; therefore, neither Langan nor the environmental database search provider can verify the completeness and accuracy of the database information. Appendix F contains a copy of the report, with specific source and property descriptions, and the dates of the last update for each database searched. Langan reviewed the database search report on a record-by-record basis to evaluate if certain properties identified in the database report are likely to represent an environmental concern for the subject property. The evaluation criteria included factors such as distance, groundwater gradient, nature of the listing, and regulatory status. Unless specifically discussed in the body of this report, the facilities listed on the database do not appear to represent an environmental concern to the subject property.

Appendix A Figures

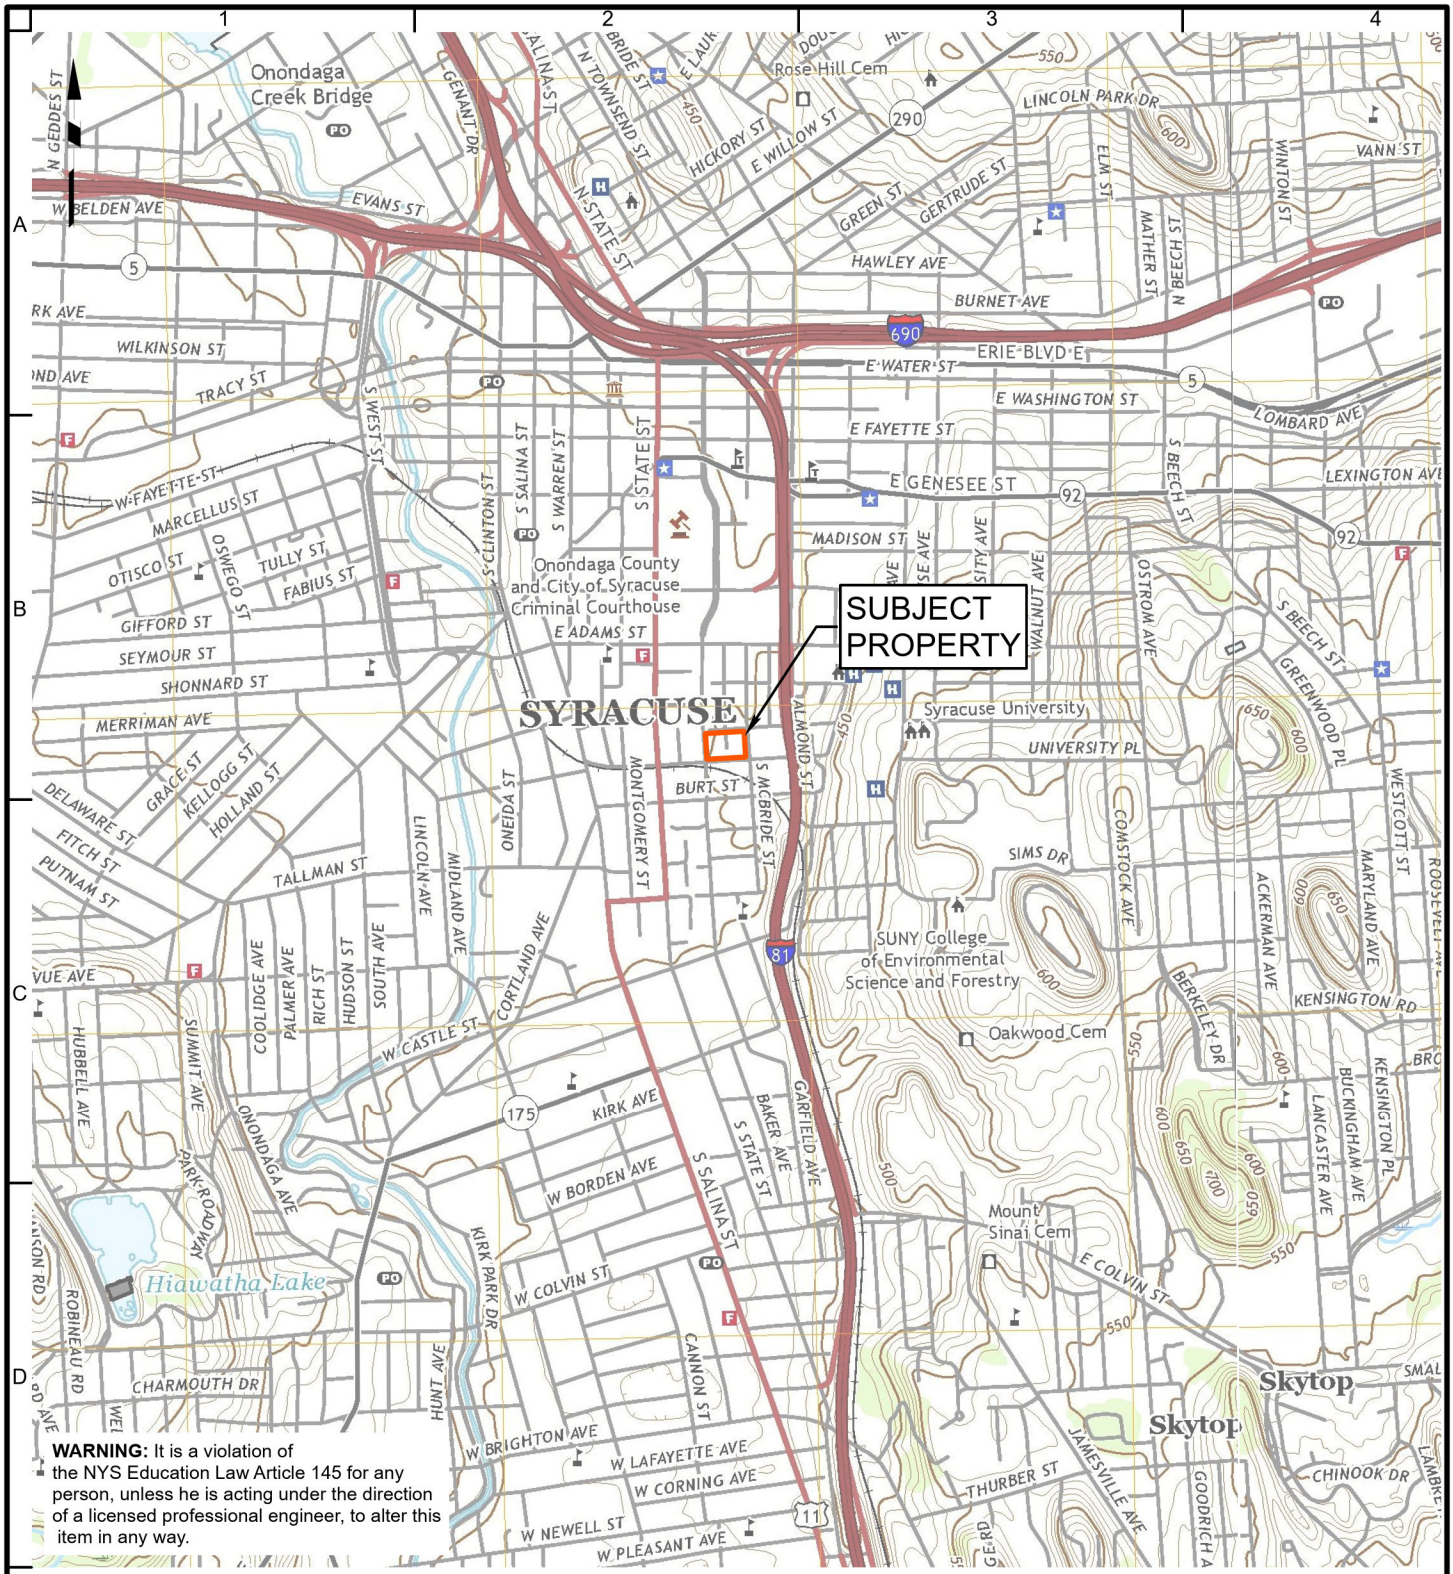

Legend

Subject Property

2,000 0 2,000

SCALE IN FEET

Notes:

1. Basemap adapted from United States Geological Survey (USGS) 7.5-Minute Series Topographical Maps, Syracuse West, New York, Quadrangle.

LANGAN

Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C.

368 Ninth Avenue, 8th Floor
New York, NY 10001-2727

T: 212.479.5400 F: 212.479.5444
www.langan.com

Project	Figure Title	Project No.	Figure
EAST ADAMS REDEVELOPMENT - PHASE 6 AREA SYRACUSE ONONDAGA COUNTY NEW YORK	SUBJECT PROPERTY LOCATION MAP	170859701	1
		Date: 6/25/2025	
		Scale: 1" = 2,000'	
		Drawn By: GS	

© 2025 Langan

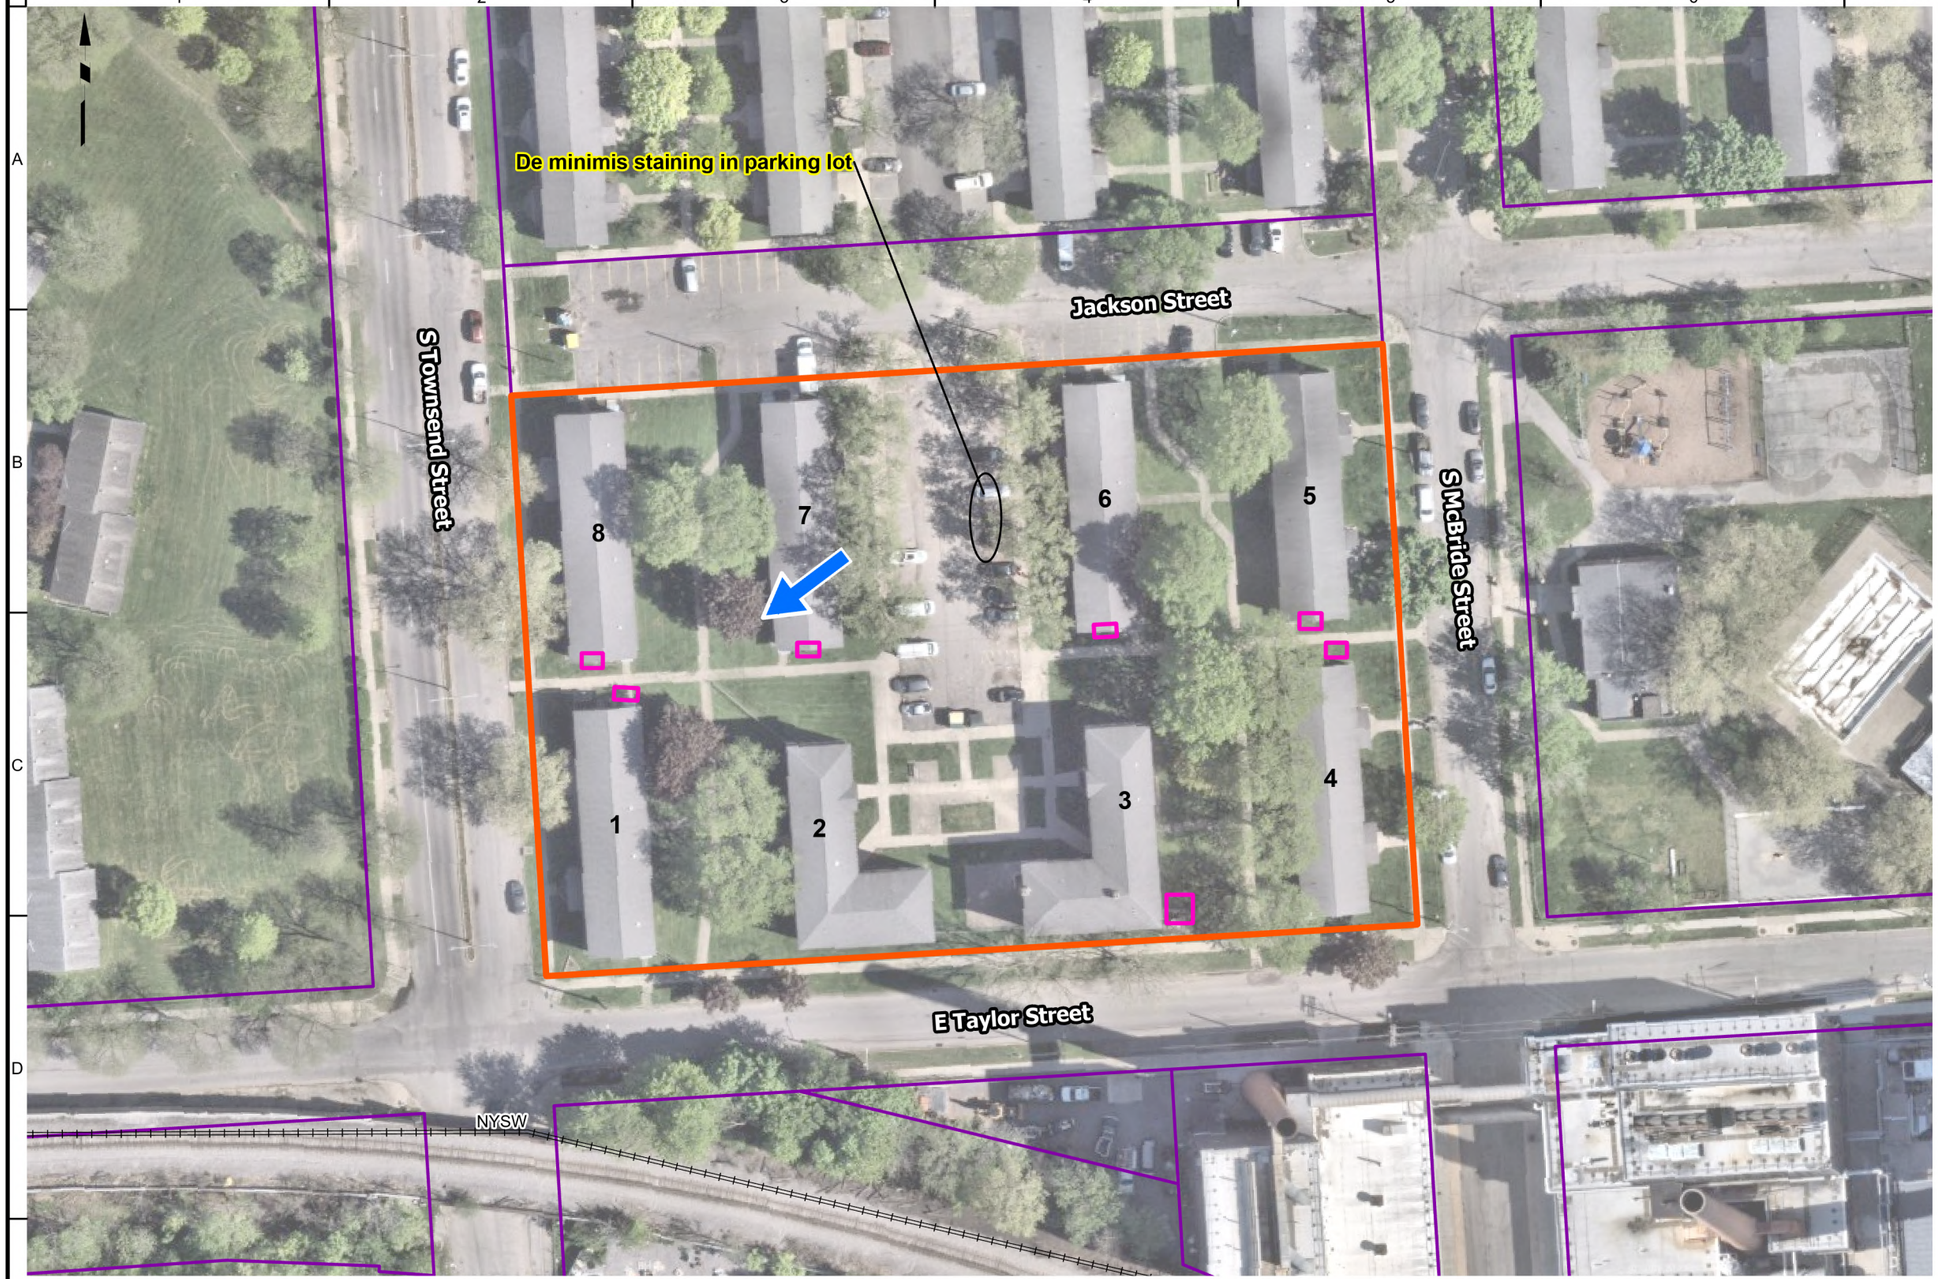

Legend

- Transformer Locations
- Subject Property
- Parcel Boundary
- Rail Lines
- Inferred Groundwater Flow Direction
- 6 Building Number

Notes:
1. Aerial imagery provided through Langan's subscription to Near Map, dated 04/30/2025.
2. Parcel data provided by Onondaga County.
3. All locations of site reconnaissance observations are approximate.
4. Groundwater flow direction inferred from review of topographic maps.

WARNING: It is a violation of the NYS Education Law Article 145 for any person, unless he is acting under the direction of a licensed professional engineer, to alter this item in any way.

70 0 70
SCALE IN FEET

LANGAN
Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C.
368 Ninth Avenue, 8th Floor
New York, NY 10001-2727
T: 212.479.5400 F: 212.479.5444 www.langan.com

Project
EAST ADAMS REDEVELOPMENT - PHASE 6 AREA
SYRACUSE
ONONDAGA COUNTY NEW YORK

Figure Title
SUBJECT PROPERTY LAYOUT

Project No.	170859701
Date	7/10/2025
Scale	1"=70'
Drawn By	GS

Figure 2

© 2025 Langan

Path: \\langan.com\data\NYC\data7\170859701\Project Data\ArcGIS\APRX\170859701 Phase 4-12\170859701 Phase 4-12.aprx Date: 7/10/2025 User: rboekenheide Time: 3:18 PM

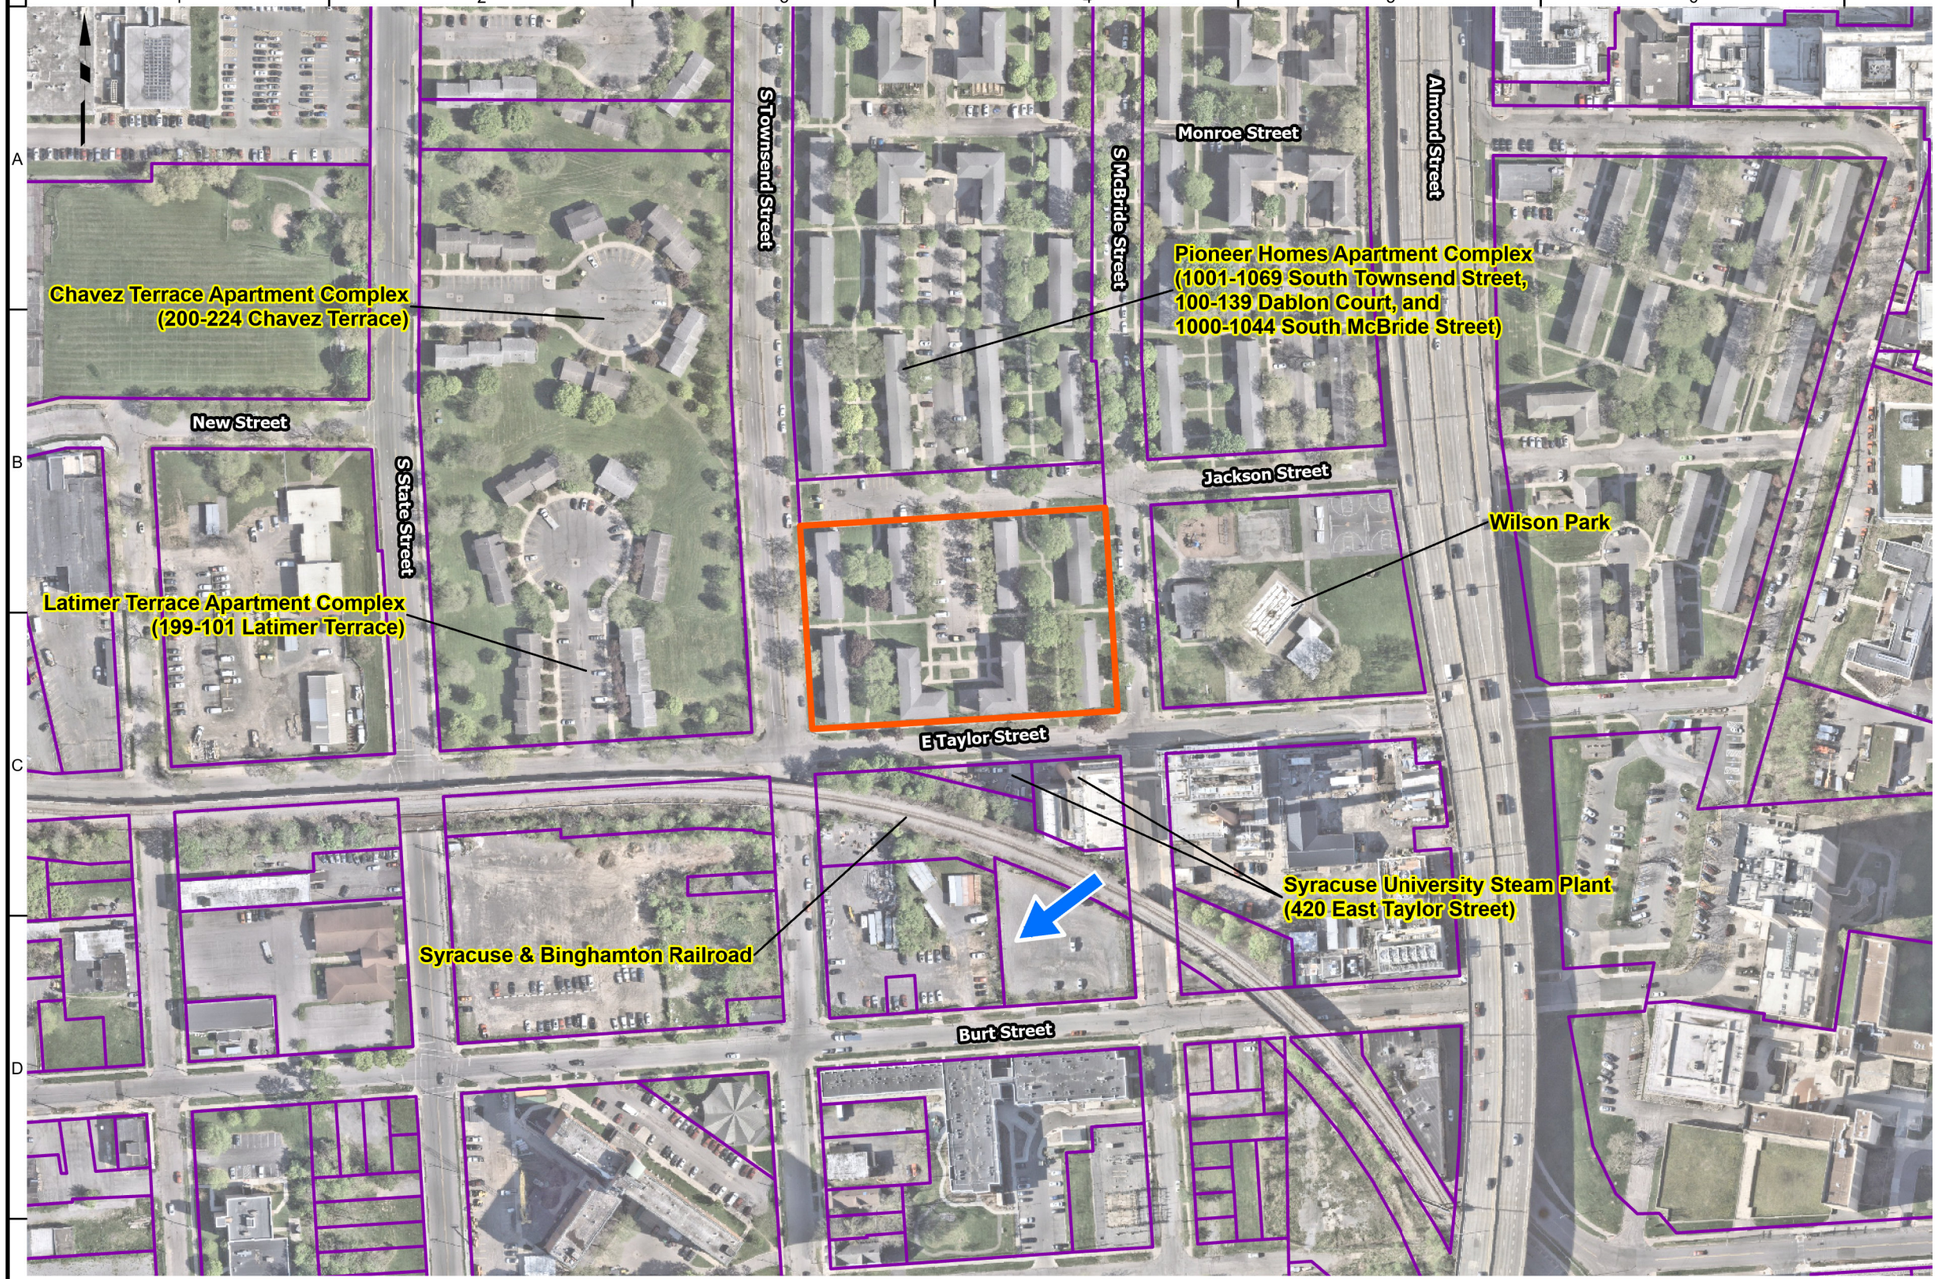

Legend

- Subject Property
- Parcel Boundary
- Inferred Groundwater Flow Direction

Notes:
1. Aerial imagery provided through Langan's subscription to Near Map, dated 04/30/2025.
2. Parcel data provided by Onondaga County.
3. Groundwater flow direction inferred from review of topographic maps.

WARNING: It is a violation of the NYS Education Law Article 145 for any person, unless he is acting under the direction of a licensed professional engineer, to alter this item in any way.

200 0 200
SCALE IN FEET

LANGAN
Langan Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C.
368 Ninth Avenue, 8th Floor
New York, NY 10001-2727
T: 212.479.5400 F: 212.479.5444 www.langan.com

Project: EAST ADAMS REDEVELOPMENT - PHASE 6 AREA
SYRACUSE
ONONDAGA COUNTY NEW YORK

Figure Title: NEARBY PROPERTIES MAP

Project No. 170859701
Date 7/3/2025
Scale 1"=200'
Drawn By GS

Figure 3

© 2025 Langan

Path: \\langan.com\data\NYC\data7\170859701\Project Data\ArcGIS\APRX\170859701 Phase 4-12\170859701 Phase 4-12.aprx Date: 7/3/2025 User: Gsajbel Time: 12:40 PM

Appendix B Agency Records and Other Reports

National Geologic Map Database

Preview

Rickard, L.V., Isachsen, Y.W., and Fisher, D.W., 1970, Geologic map of New York: New York State Museum and Science Service, Map and Chart Series 15, scale 1:250,000

Explanation

Poor quality image? Let us know

National Geologic Map Database

Preview

Rickard, L.V., Isachsen, Y.W., and Fisher, D.W., 1970, Geologic map of New York: New York State Museum and Science Service, Map and Chart Series 15, scale 1:250,000
Finger Lakes sheet

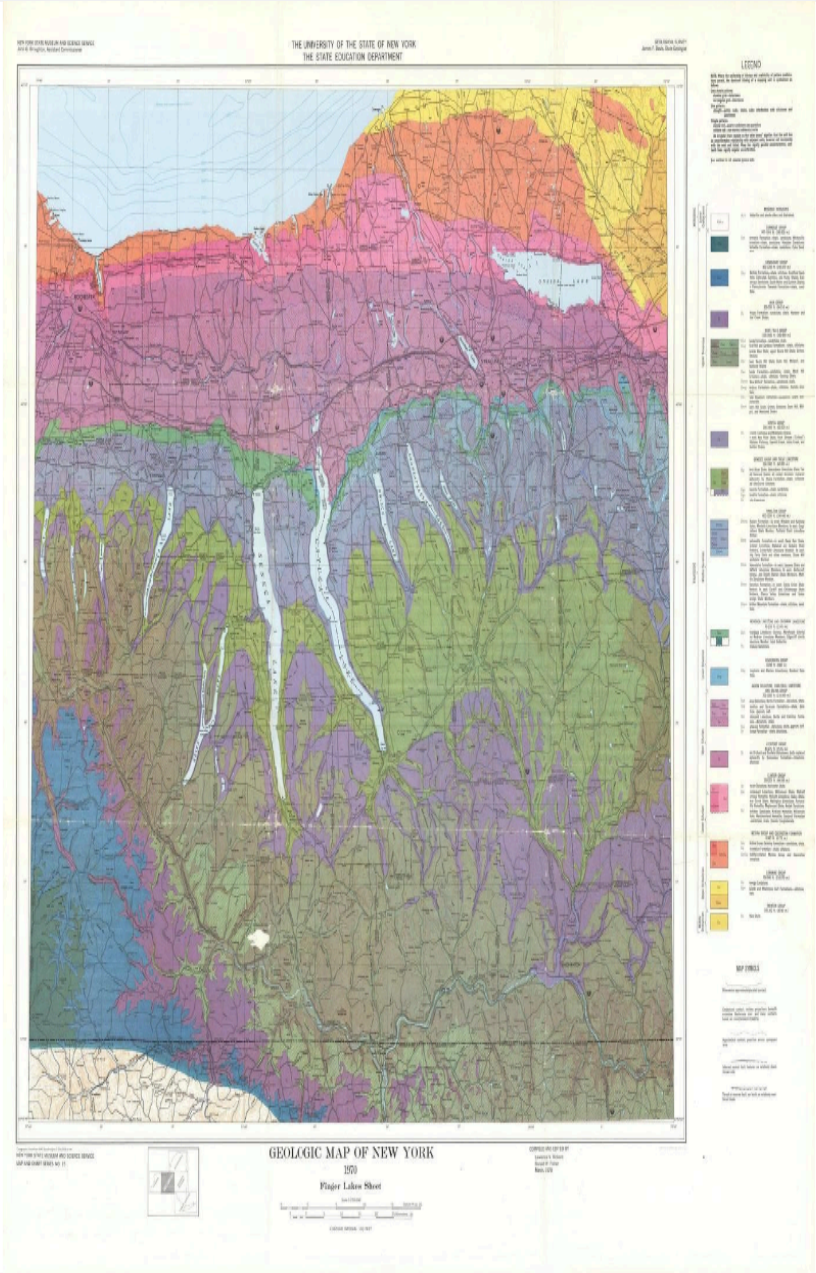

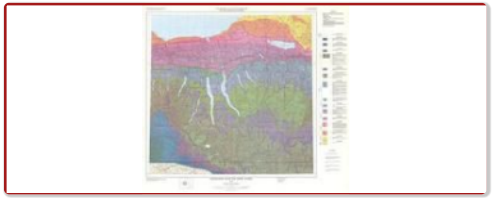

Poor quality image? Let us know

Image Mate Online

Navigation | GIS Map | Tax Maps | ORPS Links | Assessment Info | Help | Contact Us | Log In

Commercial

Property Info
Owner/Sales
Inventory
Improvements

Report

Tax Info

Click the button below to view/print tax bills, receipts and delinquent tax amounts.

Tax Info

Municipality of City of Syracuse

SWIS:	311500	Tax ID:	095.-11-01.0
Property #:	0963001000 (Click for tax info)		

Tax Map ID / Property Data

Status:	Active	Roll Section:	Wholly Exem
Address:	218 New St		
Property Class:	433 - Auto body	Site Property Class:	433 - Auto body
Ownership Code:			
Site:	Com 1	In Ag. District:	No
Zoning Code:	006 -	Bldg. Style:	Not Applicable
Neighborhood:	15920 -	School District:	Syracuse
Total Acreage/Size:	294.98 x 418.2	Equalization Rate:	----
Land Assessment:	2025 - $267,200	Total Assessment:	2025 - $735,800
Full Market Value:	2025 - $1,279,652		
Deed Book:	3303	Deed Page:	178
Grid East:	616240	Grid North:	1107885

Special Districts for 2025

Description	Units	Percent	Type	Value
SKC03-Com SE Sidewalk	1	0%		0
FL001-Sweeping	842	0%		0
CWR50-County water E	0	0%		0
CSW16-Onon Co Comm Consump	1	0%		0

Photographs

No Photo Available

Pictometry Connect

Documents

No documents found for this parcel

Maps

View Tax Map
Pin Property on GIS Map
View in Google Maps
View in Bing Maps

Map Disclaimer

Exemptions for 2025

Code Description	Amount	Exempt%	Start Year	End Year	Vflag	Hcode	Own%
18080 - SYR HOUSNG	$735,800	0	1993				0

Land Types

Type	Size
Primary	120,548.00 sq ft

Map Scale: 1:838 if printed on A portrait (8.5" x 11") sheet.

N

Meters
0 10 20 40 60

Feet
0 40 80 160 240

Map projection: Web Mercator Corner coordinates: WGS84 Edge tics: UTM Zone 18N WGS84

MAP LEGEND

Area of Interest (AOI)

- Area of Interest (AOI)

Soils

- Soil Map Unit Polygons
- Soil Map Unit Lines
- Soil Map Unit Points

Special Point Features

- Blowout
- Borrow Pit
- Clay Spot
- Closed Depression
- Gravel Pit
- Gravelly Spot
- Landfill
- Lava Flow
- Marsh or swamp
- Mine or Quarry
- Miscellaneous Water
- Perennial Water
- Rock Outcrop
- Saline Spot
- Sandy Spot
- Severely Eroded Spot
- Sinkhole
- Slide or Slip
- Sodic Spot
- Spoil Area
- Stony Spot
- Very Stony Spot
- Wet Spot
- Other
- Special Line Features

Water Features

- Streams and Canals

Transportation

- Rails
- Interstate Highways
- US Routes
- Major Roads
- Local Roads

Background

- Aerial Photography

MAP INFORMATION

The soil surveys that comprise your AOI were mapped at 1:20,000.

Warning: Soil Map may not be valid at this scale.

Enlargement of maps beyond the scale of mapping can cause misunderstanding of the detail of mapping and accuracy of soil line placement. The maps do not show the small areas of contrasting soils that could have been shown at a more detailed scale.

Please rely on the bar scale on each map sheet for map measurements.

Source of Map: Natural Resources Conservation Service
Web Soil Survey URL:
Coordinate System: Web Mercator (EPSG:3857)

Maps from the Web Soil Survey are based on the Web Mercator projection, which preserves direction and shape but distorts distance and area. A projection that preserves area, such as the Albers equal-area conic projection, should be used if more accurate calculations of distance or area are required.

This product is generated from the USDA-NRCS certified data as of the version date(s) listed below.

Soil Survey Area: Onondaga County, New York
Survey Area Data: Version 19, Aug 29, 2024

Soil map units are labeled (as space allows) for map scales 1:50,000 or larger.

Date(s) aerial images were photographed: Aug 3, 2021—Nov 7, 2021

The orthophoto or other base map on which the soil lines were compiled and digitized probably differs from the background imagery displayed on these maps. As a result, some minor shifting of map unit boundaries may be evident.

Map Unit Legend

Map Unit Symbol	Map Unit Name	Acres in AOI	Percent of AOI
Ub	Urban land	3.4	100.0%
Totals for Area of Interest		**3.4**	**100.0%**

REZONE SYRACUSE
A Citywide Zoning Update

REZONE SYRACUSE ZONING MAP

Syracuse New York

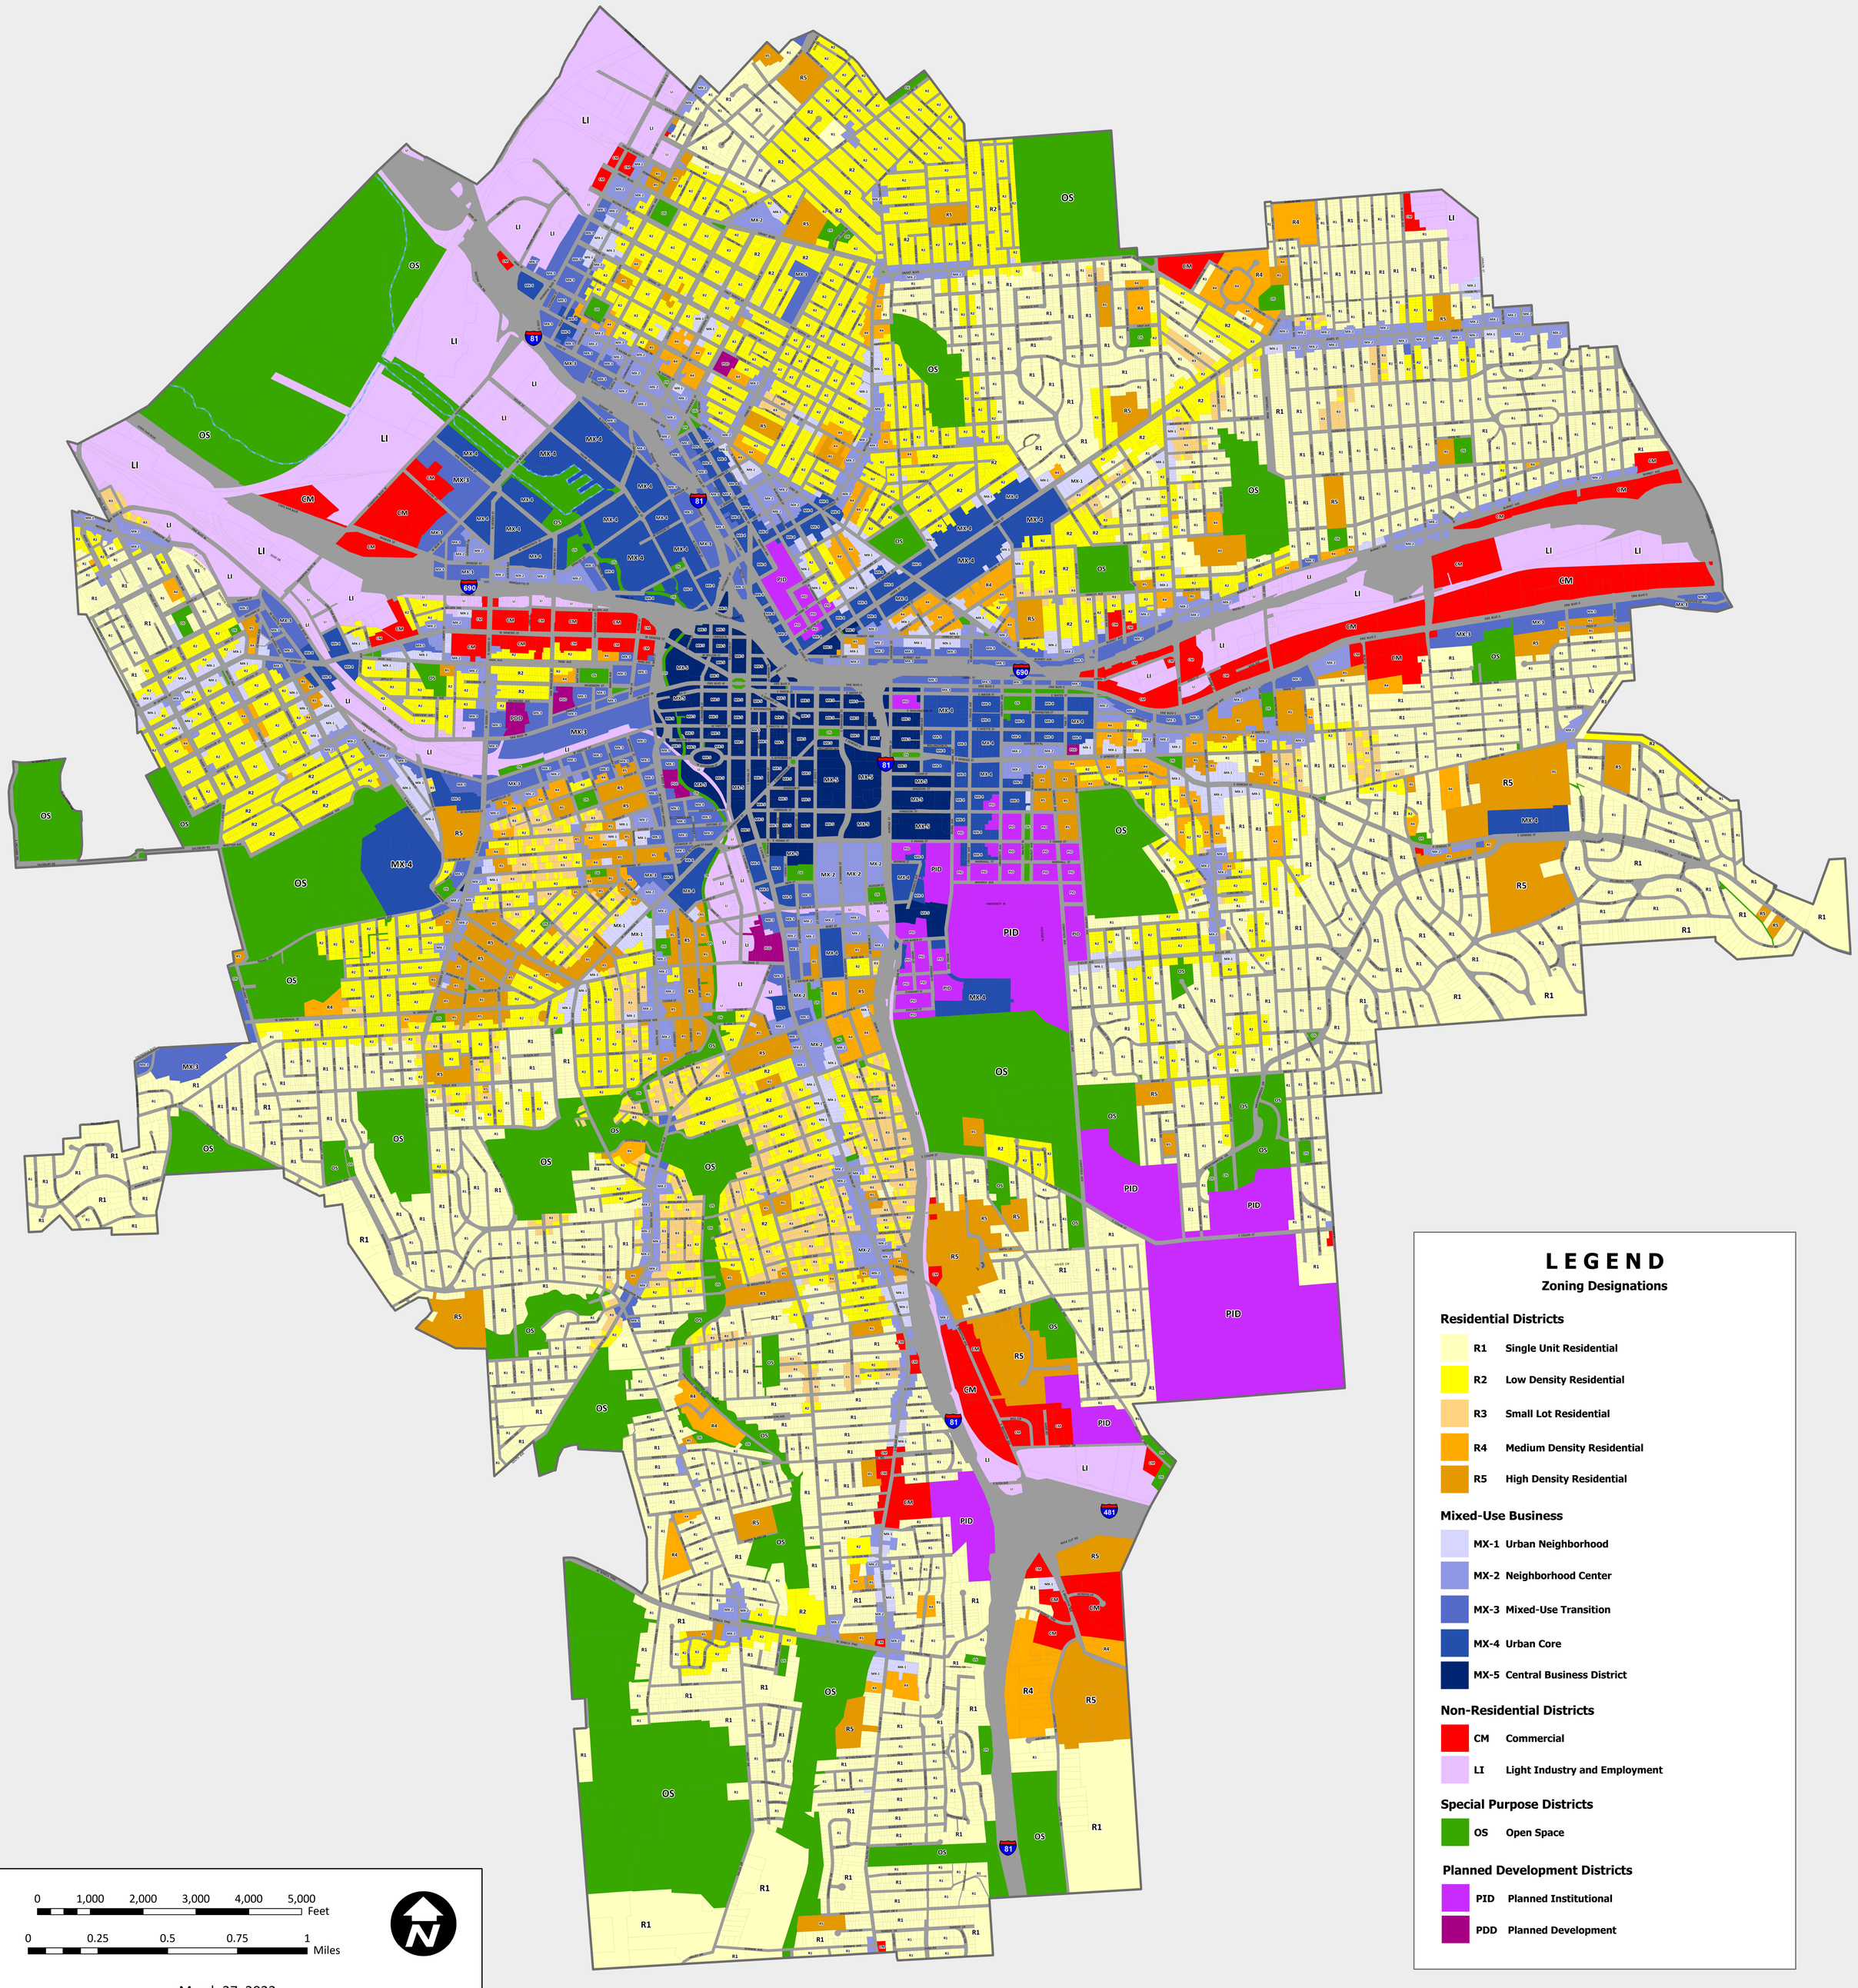

Appendix C Site Reconnaissance Checklist and Photographs

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-24-25	1.

Direction Photo Taken:

South

Description:

View of multi-level buildings and on-site dumpsters at the subject property.

Date	Photo No.
6-24-25	2.

Direction Photo Taken:

North

Description:

View of typical rowhouse building at the subject property.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-24-25	3.

Direction Photo Taken:

Northwest

Description:

View of basement of Building 3.

Date	Photo No.
6-24-25	4.

Direction Photo Taken:

North

Description:

A natural gas-fired heating unit in the basement of Building 3.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-24-25	5.

Direction Photo Taken:

Northwest

Description:

View of miscellaneous retail-sized cleaning supplies in the basement of Building 2.

Date	Photo No.
6-24-25	6.

Direction Photo Taken:

West

Description:

A floor drain and sanitary cleanout in the basement of Building 3.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-24-25	7.

Direction Photo Taken:

Northwest

Description:

View of the former incinerator in the basement of Building 3 used for trash incineration.

Date	Photo No.
6-24-25	8.

Direction Photo Taken:

East

Description:

View of electrical meters in the basement of Building 3.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-24-25	9.

Direction Photo Taken:

East

Description:

An electrical transformer in the basement of Building 3.

Date	Photo No.
6-24-25	10.

Direction Photo Taken:

East

Description:

General view of the boiler room in the basement of Building 3.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-24-25	11.

Direction Photo Taken:

East

Description:

An ejector pit in the boiler room of Building 3. Pooled water was observed near the ejector pit within the boiler room.

Date	Photo No.
6-24-25	12.

Direction Photo Taken:

Northwest

Description:

View of a pump room off the boiler room in Building 3. Apparent water staining and infiltration was observed on the walls and floor of the pump room.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-24-25	13.

Direction Photo Taken:

North

Description:

Water pump equipment in the pump room of Building 3.

Date	Photo No.
6-24-25	14.

Direction Photo Taken:

North

Description:

Expansion tanks in the pump room of Building 3.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-24-25	15.

Direction Photo Taken:

West

Description:

Potable water connections in Building 3 basement.

Date	Photo No.
6-24-25	16.

Direction Photo Taken:

Southeast

Description:

View of courtyard space over the pump room in the basement of Building 3.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-24-25	17.

Direction Photo Taken:

South

Description:

View of the basement in Building 2.

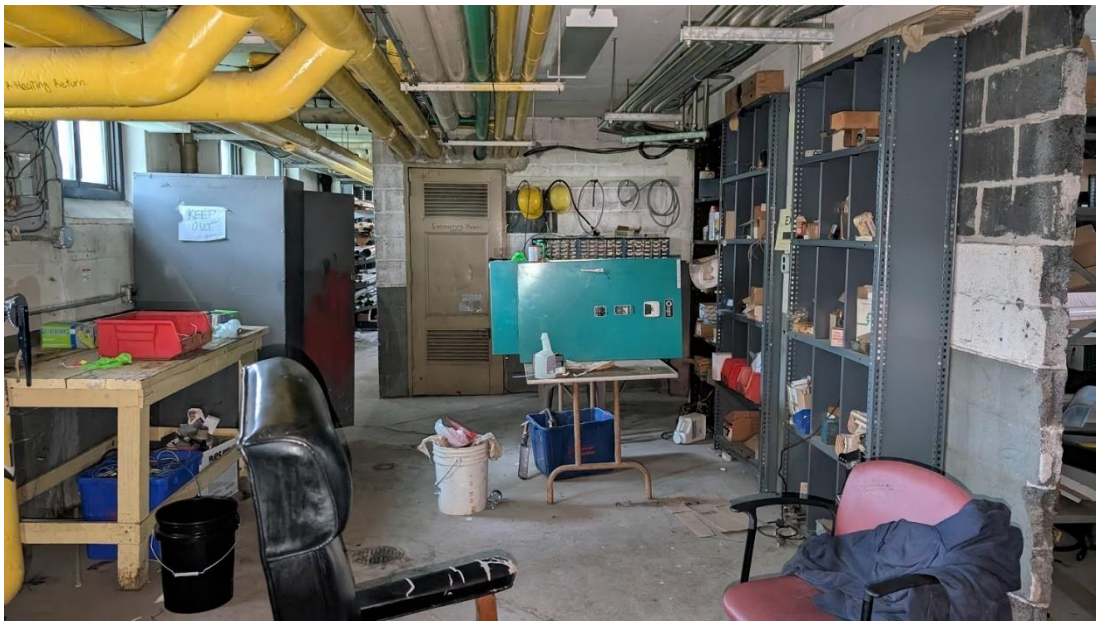

Date	Photo No.
6-24-25	18.

Direction Photo Taken:

Southwest

Description:

View of a floor drain and sanitary cleanouts in the basement of Building 2.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-24-25	19.

Direction Photo Taken:

Northwest

Description:

A natural gas-fired heating unit in the basement of Building 2.

Date	Photo No.
6-24-25	20.

Direction Photo Taken:

North

Description:

View of various retail-sized maintenance products stored in the basement of Building 2.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-24-25	21.

Direction Photo Taken:

East

Description:

Electrical transformers in the basement of Building 2.

Date	Photo No.
6-24-25	22.

Direction Photo Taken:

West

Description:

The former incinerator in the basement of Building 2.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-24-25	23.

Direction Photo Taken:

South

Description:

View of electrical meters in the basement of Building 2.

Date	Photo No.
6-24-25	24.

Direction Photo Taken:

North

Description:

View of Radisson Court and de minimis pavement staining on the eastern side of the parking lot.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-24-25	25.

Direction Photo Taken:

West

Description:

View of a sanitary vent in a landscaped area of the subject property.

Date	Photo No.
6-24-25	26.

Direction Photo Taken:

Northwest

Description:

The Pioneer Homes at Dablon Court, which adjoins the subject property to the north, across Jackson Street.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-26-26	27.

Direction Photo Taken:

Southeast

Description:

Wilson Park, which adjoins the subject property to the east, across South McBride Street.

Date	Photo No.
6-26-25	28.

Direction Photo Taken:

South

Description:

The Syracuse University Steam Station, which adjoins the subject property to the south, across East Taylor Street.

LANGAN

Site Reconnaissance Photos

Client Name:	Site Location:	Project No.
McCormack Baron Salazar, Inc.	East Adams Redevelopment Area Phase VI – 100 Radisson Court, Syracuse, New York	170859701

Date	Photo No.
6-26-25	29.

Direction Photo Taken:

East

Description:

The adjoining wooded area, across East Taylor Street.

Date	Photo No.
6-26-25	30.

Direction Photo Taken:

West

Description:

The McKinney Manor residences at Latimer Terrace, which adjoin the subject property to the west, across South Townsend Street.

LANGAN

PHASE I ESA SITE RECONNAISSANCE CHECKLIST

GENERAL INFORMATION

Langan personnel: Olivia Miller
Dates of site reconnaissance: 24 June 2025
Business name / subject property occupant: East Adams Redevelopment – Phase 6 (Radisson Court)
Full subject property address:

- 1117 – 1131 South Townsend Street (Building 1)
- 116 – 118 Radisson Court (Building 2)
- 117 – 119 Radisson Court (Building 3)
- 1116 – 1130 South McBride Street (Building 4)
- 1100 – 1114 South McBride Street (Building 5)
- 101 – 115 Radisson Court (Building 6)
- 100 – 114 Radisson Court (Building 7)
- 1101 – 1115 Radisson Court (Building 8)

Weather conditions: 89º, sunny

Features, Activities, Uses, and Conditions	**Identified/Observed?**		**Report Section(s)**
General Subject Property Setting	**Yes**	**No**	
Current use(s) of the subject property	☒	☐	2.0
Past use(s) of the subject property	☐	☒	3.1
Current use(s) of adjoining properties	☒	☐	4.1
Past use(s) of adjoining properties	☐	☒	4.2
Current or past uses in the surrounding area	☒	☐	4.1 and 4.2
Geologic, hydrogeologic, hydrologic, and topographic conditions	☒	☐	2.2
Structures and other improvements at the subject property	☒	☐	2.3
Roads	☒	☐	2.3
Potable water supply/source for the subject property	☒	☐	2.4
Sewage disposal system for the subject property	☒	☐	2.4

Interior/Exterior Features	**At Interior?**		**At Exterior?**		**Report Section(s) (if yes)**
	Yes	**No**	**Yes**	**No**	
Hazardous substances and petroleum products in connection with identified uses	☐	☒	☐	☒	2.5
Storage tanks	☐	☒	☐	☒	2.5.1 and 2.5.2
Strong, pungent, or noxious odors and their sources	☐	☒	☐	☒	2.6
Standing surface water and pools or sumps containing liquids likely to be hazardous substances or petroleum products	☐	☒	☐	☒	2.5
Drums, totes, and intermediate bulk containers	☐	☒	☐	☒	2.5.3
Hazardous substance and petroleum product containers not in connection with identified uses	☐	☒	☐	☒	2.5.4
Unidentified substance containers	☐	☒	☐	☒	2.5.4
PCB-containing items	☒	☐	☒	☐	2.5.4
Heating/cooling	☒	☐	☒	☐	2.4
Stains or corrosion on floors, walls, or ceilings	☒	☐	☐	☒	2.5 and 2.7
Drains and sumps	☒	☐	☒	☐	2.8
Pits, ponds, or lagoons	☐	☒	☐	☒	2.2.3
Stained soil or pavement	☐	☒	☒	☐	2.5 and 2.7
Stressed vegetation	☐	☒	☐	☒	2.9
Solid waste	☐	☒	☒	☐	2.7
Water/wastewater	☒	☐	☐	☒	2.8 and 2.9
Wells	☐	☒	☐	☒	2.2.3
Septic systems or cesspools	☐	☒	☐	☒	2.8

Appendix D User Provided Information

User Questionnaire
Introduction/Limitations
November 2021

The information in this User Questionnaire is prepared and provided by the *user** to the environmental professional pursuant to 40 CFR 313.22 in order to qualify for one of the *Landowner Liability Protections* (LLPs) offered by the Small Business Liability Relief and Brownfields Revitalization Act of 2001 (the *"Brownfields Amendments"*). The user must conduct the following inquiries required by 40 C.F.R. §§ 312.25, 312.28, 312.29, 312.30, and 312.31. These inquiries must also be conducted by EPA Brownfield Assessment and Characterization grantees. The user should provide the following information to the environmental professional. Failure to conduct these inquiries could result in a determination that "all appropriate inquiries" is not complete.

*Pursuant to ASTM E 1527-21, the "user" is the party seeking to complete the environmental site assessment of the property. It is also the person seeking to establish one or more of the Landowner Liability Protections (LLPs) under CERCLA. A user may include, without limitation, a potential purchaser or potential leasee or tenant of the property, an owner of the property, a lender or a property manager.

DATE PREPARED: 7.16.25

SUBJECT PROPERTY (address): East Adams VI, SE Corner of Jackson St. & Townsend St., Syracuse, NY

USER(S): East Adams Phase VI, L.P.

NAME OF PERSON COMPLETING QUESTIONNAIRE: Michael Saunders

(1) Environmental liens that are filed or recorded against the subject property (40 C.F.R. § 312.25).

Did a search of land title records (or judicial records where appropriate, see Note 1 below) identify any environmental liens filed or recorded against the subject property under federal, tribal, state, or local law?

NOTE 1—In certain jurisdictions, federal, tribal, state, or local statutes, or regulations specify that *environmental liens* and *AULs* be filed in judicial records rather than in *land title records*. In such cases judicial records shall be searched for *environmental liens* and *AULs*.

Answer: The Environmental Professional is hereby requested to conduct the search for environmental cleanup liens and the results will be included in the Phase I Report. Except as provided in the Phase I Report, the user has not identified any environmental cleanup liens.

(2) Activity and use limitations that are in place on the subject property or that have been filed or recorded against the subject property.

Did a search of land title records (or judicial records where appropriate, see Note 1 above) identify any AULs, such as engineering controls, land use restrictions or institutional controls that are in place at the subject property and/or have been filed or recorded against the subject property under federal, tribal, state or local law?

Answer: The Environmental Professional is hereby requested to perform the search for AULs and the results will be included in the Phase I Report. Except as provided in the Phase I Report, the user has not identified any AULs for the subject property.

(3) Specialized knowledge or experience of the person seeking to qualify for the LLP (40 C.F.R. § 312.28).

Do you have any specialized knowledge or experience related to the subject property or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the subject property or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business?

Answer: The user is a developer of multifamily and mixed-use properties and has provided to the Environmental Professional all specialized knowledge, if any, that is has in connection with the subject property or nearby properties relevant to environmental matters.

(4) Relationship of the purchase price to the fair market value of the subject property if it were not contaminated (40 C.F.R. § 312.29).

Does the purchase price being paid for this subject property reasonably reflect the fair market value of the property? If you conclude that there is a difference, have you considered whether the lower purchase price is because contamination is known or believed to be present at the subject property?

Answer: In the opinion of the user, the lease price reasonably reflects the fair market value of the subject property, given the non-environmental use restrictions imposed as part of the lease. The user believes the lease price reflects several factors, including the overall physical and economic conditions at and near the subject property and the seller's desire to encourage and incentivize redevelopment of the subject property for a public good. To the knowledge of the user, the lease price has not been adjusted to reflect any real or potential contamination that might be found at the subject property.

(5) Commonly known or reasonably ascertainable information about the subject property (40 C.F.R. § 312.30).

Are you aware of commonly known or reasonably ascertainable information about the subject property that would help the environmental professional to identify conditions indicative of releases or threatened releases? For example,

(a) Do you know the past uses of the subject property?

The user has provided the Environmental Professional with all relevant information/documents, if any, in its possession concerning former uses of the subject property.

(b) Do you know of specific chemicals that are present or once were present at the subject property?

The user has provided to the Environmental Professional all information/documents, if any, in its possession concerning specific chemicals that are present or once were present at the subject property.

(c) Do you know of spills or other chemical releases that have taken place at the subject property?

The user has provided to the Environmental Professional with all information/documents, if any, in its possession concerning spills or other chemical releases at the subject property.

(d) Do you know of any environmental cleanups that have taken place at the subject property?

The user has provided to the Environmental Professional all information/documents, if any, in its possession concerning environmental cleanups that have taken place at the subject property.

(6) The degree of obviousness of the presence or likely presence of contamination at the subject property, and the ability to detect the contamination by appropriate investigation (40 C.F.R. § 312.31).

Based on your knowledge and experience related to the subject property, are there any obvious indicators that point to the presence or likely presence of releases at the subject property?

Answer: To the user's knowledge, the subject property has been used for various residential and commercial purposes, but the user has not observed obvious indication of contamination at the subject property, other than information/documents that have been provided to the Environmental Professional.

Additional Questions:

(I) Helpful Documents

Do you know whether any of the environmental documents listed in Section 10.8.1 of ASTM E1527-21 exist? If so, can copies be provided to the environmental professional?

Answer: The user has provided to the Environmental Professional all information/documents, if any, in its possession relevant to environmental evaluations conducted at or for the subject property.

(II) Proceedings Involving the Subject Property Questions

Do you know of:

(1) Any pending, threatened, or past litigation relevant to hazardous substances or petroleum products in, on, at, or from the subject property?

Answer: The user has provided to the Environmental Professional all information/documents, if any, in its possession concerning pending, threatened, or past litigation relevant to hazardous substances and/or petroleum products in, on, at or from the subject property.

(2) Any pending, threatened, or past administrative proceedings relevant to hazardous substances or petroleum products in, on, at, or from the subject property?

Answer: The user has provided to the Environmental Professional all information/documents, if any, in its possession concerning pending, threatened, or past administrative proceedings relevant to hazardous substances and/or petroleum products in, on, at or from the subject property.

(3) Any notices from any governmental entity regarding any possible violation of environmental laws or possible liability relating to hazardous substances or petroleum products?

Answer: The user has provided to the Environmental Professional all information/documents, if any, in its possession concerning any possible violation of environmental laws or possible liability related to hazardous substances and/or petroleum products with respect to the subject property.

First American Title™

Certificate of Title

ISSUED BY
First American Title Insurance Company

Certificate

FIRST AMERICAN TITLE INSURANCE COMPANY ("the Company") certifies to the "proposed insured(s)" listed herein that an examination of title to the premises described in Schedule A has been made in accordance with its usual procedure and agrees to issue its standard form of title insurance policy authorized by the Insurance Department of the State of New York, in the amount set forth herein, insuring the interest set forth herein, and the marketability thereof, in the premises described in Schedule A, after the closing of the transaction in conformance with the requirements and procedures approved by the Company and after the payment of the premium and fees associated herewith excepting (a) all loss or damage by reason of the estates, interests, defects, objections, liens, encumbrances and other matters set forth herein that are not disposed of to the satisfaction of the Company prior to such closing or issuance of the policy (b) any question or objection coming to the attention of the Company before the date of closing, or if there be no closing, before the issuance of the policy.

This Agreement to insure shall terminate (1) if the prospective insured, his or her attorney or agent makes any untrue statement with respect to any material fact or suppresses or fails to disclose any material fact or if any untrue answers are given to material inquiries by or on behalf of the Company; or (2) upon the issuance of title insurance in accordance herewith. In the event that this Certificate is endorsed and redated by an authorized representative of the Company after the closing of the transaction and payment of the premium and fees associated herewith, such "redated" Certificate shall serve as evidence of the title insurance issued until such time as a policy of title insurance is delivered to the insured. Any claim made under the redated Certificate shall be restricted to the conditions, stipulations and exclusions from coverage of the standard form of title insurance policy issued by the Company.

THIS REPORT IS NOT A TITLE INSURANCE POLICY! PLEASE READ IT CAREFULLY.
THE REPORT MAY SET FORTH EXCLUSIONS UNDER THE TITLE INSURANCE POLICY AND MAY NOT LIST ALL LIENS, DEFECTS, AND ENCUMBRANCES AFFECTING TITLE TO THE PROPERTY.
YOU SHOULD CONSIDER THIS INFORMATION CAREFULLY.

In Witness Whereof, First American Title Insurance Company has caused its corporate name and seal to be affixed by its duly authorized officers on the date shown in Schedule A.

First American Title Insurance Company

Dennis J. Gilmore
President

Greg L. Smith
Secretary

(This Certificate is valid only when Schedules A and B are attached)

CLOSING REQUIREMENTS

1. CLOSING DATE: In order to facilitate the closing of title, please notify the closing department at least 48 hours prior to the closing, of the date and place of closing, so that searches may be continued.
2. PROOF OF IDENTITY: Identity of all persons executing the papers delivered on the closing must be established to the satisfaction of the Company.
3. POWER OF ATTORNEY: If any of the closing instruments are to be executed pursuant to a Power of Attorney, a copy of such Power should be submitted to the Company prior to closing. THE IDENTITY OF THE PRINCIPAL EXECUTING THE POWER AND THE CONTINUED EFFECTIVENESS OF THE POWER MUST BE ESTABLISHED TO THE SATISFACTION OF THE COMPANY. The Power must be in recordable form.
4. CLOSING INSTRUMENTS: If any of the closing instruments will be other than commonly used forms or contain unusual provisions, the closing can be simplified and expedited by furnishing the Company with copies of the proposed documents in advance of closing.
5. LIEN LAW CLAUSE: Deeds and mortgages must contain the covenant required by Section 13 of the Lien Law. The covenant is not required in deeds from referees or other persons appointed by a court for the sole purpose of selling property.
6. REFERENCE TO SURVEYS AND MAPS: Closing instruments should make no reference to surveys or maps unless such surveys or maps are on file.
7. INTERMEDIARY DEEDS: In the event an intermediary will come into title at closing, other than the ultimate insured, the name of such party must be furnished to the Company in advance of closing so that appropriate searches can be made and relevant exceptions considered.

MISCELLANEOUS PROVISIONS

1. This certificate is intended for lawyers only. Your lawyers should be consulted before taking any action based upon the contents hereof.
2. The Company's closer may not act as legal advisor for any of the parties or draw legal instruments for them. The closer is permitted to be assistance only to an attorney.
3. Our policy will except from coverage any state of facts which an accurate survey might show, unless survey coverage is ordered. When such coverage is ordered, this certificate will set forth the specific survey exceptions which we will include in our policy. Whenever the word "trim" is used in any survey exceptions from coverage, it shall be deemed to include, roof cornices, moldings, belt courses, water tables, keystones, pilasters, portico, balcony all of which project beyond the street line.
4. Our examination of the title includes a search for any unexpired financing statements which affect fixtures and which have been properly filed and indexed pursuant to the Uniform Commercial Code in the office of the recording officer of the county in which the real property lies. No search has been made for other financing statements because we do not insure title to personal property. We will on request, in connection with the issuance of a title insurance policy, prepare such search for an additional charge. Our liability in connection with such search is limited to $1,000.00.
5. This company must be notified immediately of the recording or the filing, after the date of this certificate, of any instrument and of the discharge or other disposition of any mortgage, judgment, lien or any other matter set forth in this certificate and of any change in the transaction to be insured or the parties thereto. The continuation will not otherwise disclose the disposition of any lien.
6. If affirmative insurance is desired regarding any of the restrictive covenants with respect to new construction or alterations, please request such insurance in advance of closing as this request should not be considered at closing.
7. If it is discovered that there is additional property or an appurtenant easement for which insurance is desired, please contact the Company in advance of closing so that an appropriate title search may be made. In some cases, our rate manual provides for an additional charge for such insurance.

****NOTICE****

First American Title Insurance Company will collect fees to enable the recording of documents for this transaction. If it is thereafter determined that a Lender paid all or a portion of those recording fees, First American Title Insurance Company will promptly refund the amount paid by the Lender to the party from whom it was collected.

First American Title™

Certificate of Title

ISSUED BY
First American Title Insurance Company

Certification Page

TN0134-107-T

Title No.: TN0134-107-T

Effective Date: September 9, 2024 at 08:00 AM

Redated:

Proposed Insured:

Purchaser/Borrower: East Adams Phase VI, L.P., a New York limited partnership
Mortgagee: TBD

Amount of Insurance:

Fee: $TBD
Mortgage: $

The estate or interest in the land described or referred to in this Certificate is Fee Simple.

THIS COMPANY CERTIFIES that a good and marketable title to the premises described in Schedule "A", subject to the liens, encumbrances and other matters, if any, set forth in this certificate may be conveyed and or mortgaged by: East Adams Phase VI, L.P., a New York limited partnership

Premises described in this Schedule are known as:

Address (For Information Only): 1101 Townsend St. S., Jackson St., Syracuse, NY 13202

County: Onondaga City: Syracuse

District: Onondaga

Town: Syracuse

Village:

Section: 095

Block: 12

Lot: 01.0

Gatehouse Title Agency, LLC

_____

Efrem Levy
Authorized Countersignature

Please contact Jennifer Zatkowski at jzatkowski@gatehousetitle.com for Title Clearance Questions

First American Title™	Certificate of Title
	ISSUED BY **First American Title Insurance Company**
Schedule BI	**TN0134-107-T**

File No.: TN0134-107-T

REQUIREMENTS

The Following are requirements to be complied with for a Title Policy to issue:

1. Searches, including judgments, federal tax liens and bankruptcies have been run against East Adams Phase VI, L.P., a New York limited partnership, the certified owner(s) herein and the following must be disposed of:

   None

2. To verify at closing the identity of the persons who are executing closing documents, two forms of identification, at least one of which is to contain a photograph, is required to be presented.

3. Note: Payment at closing of any amount exceeding $100.00 must be made by a bank or certified check, by a check issued from an attorney's escrow account, or by wired funds.

4. NOTE: REAL PROPERTY TAX PAYMENTS: The recording of documents has been significantly delayed by many county recording offices in New York State. When real estate tax payments become due prior to the recording of a deed, the local tax assessor may not have sufficient information as to where tax bills are to be sent. Where this is an issue, it may be advisable to contact the office of your local tax assessor with a copy of the closing deed. First American is not responsible for the failure to receive real estate tax bills or for any additional charges that may result from the failure to timely pay such amounts. The prompt payment of real estate taxes is the responsibility of the property owner and its mortgage lender.

5. Note: Contact Counsel for the Company in advance of closing if a document is to be executed pursuant to a power of attorney.

6. The Company must be advised in writing of the name or any party not referred to in this Commitment who will acquire an interest in the land, or who will either obtain or make a loan or mortgage encumbering the land. The Company may then make additional requirements, or take additional exceptions to coverage on Schedule B, Section II.

7. Pay the agreed amount for the estate or interest to be insured.

8. Pay the premiums, fees, and charges for the Policy to the Company.

9. Pay all taxes, charges, assessments, levied and assessed against the Land, which are due and payable.

10. Documents satisfactory to the Company that convey the Title or create the Mortgage to be insured, or both, must be properly authorized, executed, delivered, and recorded in the Public Records.

11. A resolution of the Board of Commissioners of the Syracuse Housing Authority is required authorizing the sale of the premises to be insured herein.

12. The Company must be provided with the following with regard to any limited partnerships involved in this transaction, the following is required:

(a) Proof is required of its formation in accordance with Section 91 of the Partnership Law (as to domestic limited partnerships formed prior to July 1, 1991) or Subdivisions (a) and (b) of Section 121-201 of the Partnership Law (as to domestic limited partnerships formed on or after July 1, 1991) or if a foreign limited partnership in accordance with the laws of the jurisdiction of its origin and that it has not been dissolved. A copy of any amendment to the Certificate of Limited Partnership must be submitted for review in advance of closing.
(b) The Articles of Limited Partnership and any amendments thereto must be submitted to this Company for consideration in advance of the closing. Proof will be required that there has been no change in the Articles of Partnership or in the partnership's membership.
(c) The names of all of the general partners must be furnished to this Company in advance of the closing for federal tax lien and bankruptcy searches.
(d) If a foreign limited partnership:
(i) a certificate of Good Standing from the state of formation must be submitted.
(ii) proof of its authority to acquire, convey, lease or Mortgage the land as described in Schedule A, as applicable under the laws of the state of formation must be submitted in advance of closing.

(Note: a foreign limited partnership can have no greater powers than a domestic limited partnership under section 121-904-(b) of the Partnership Law.

13. Closing instruments to contain recital "Premises herein as described are and intended to be a portion of the same as those described in Deed recorded at Book 921, Page 290; Book 892, Page 449; Book 880, Page 1; Book 875, Page 7; Book 874, Page 398; Book 874, Page 394; Book 874, Page 205; Book 873, Page 493; Book 873, Page 490; Book 873, Page 223; Book 873, Page 78; Book 873, Page 72; Book 873, Page 69; Book 872, Page 225; Book 872, Page 147; Book 872, Page 64; Book 872, Page 228; Book 871, Page 326; Book 871, Page 329; Book 871, Page 323; Book 871, Page 154; Book 871, Page 106"

14. If the mortgage to be insured will be a building loan the following must be complied with:
A building loan agreement executed pursuant to Section 22 of the Lien Law must be filed at or before the time of recording of the mortgage to be insured;
Building permit must be obtained before the first advance is made;
Certificate of Occupancy must be obtained and the survey brought to date to show the completed dwelling before the final advance is made.
Pending disbursement of the full proceeds of the loan secured by the mortgage described herein, this policy insures only to the extent of the amount actually disbursed, but increases as each disbursement is made in good faith and without knowledge of any defect, in, or objections to the title, up to the face amount of the policy. At the time of each disbursement of the proceeds of the loan, the title should be continued down to such time for possible liens or objections intervening between the date hereof and the date of each disbursement.

NOTE: Upon conversion to a conventional mortgage an additional mortgage premium will be due. Please notify the company well in advance of the conversion closing date.

The building loan premium shall include the cost of the first 5 (five) continuations during the life of the construction loan mortgage. An additional fee of $200.00 for each subsequent title continuation search beyond the fifth must be paid for prior to each such continuation.

15. Record proper release of Declaration of Trust by and between Syracuse Housing Authority and the United States of America, Secretary of Housing and Urban Development, dated June 28, 1990 and recorded in Book 3641, Page 38 in the Clerk's Office for Onondaga County, New York, as corrected by Corrective Declaration of Trust recorded in Book 5305, Page 859 in the Clerk's Office for Onondaga County, New York.

16. Record proper release of Declaration of Trust by and between Syracuse Housing Authority and the United States of America, Secretary of Housing and Urban Development, dated November 19, 2015 and recorded in Book 5358, Page 702 in the Clerk's Office for Onondaga County, New York, as amended by Amended Declaration of Trust recorded in Book 5425, Page 101 in the Clerk's Office for Onondaga County, New York.

SCHEDULE BI
(Continued)

17. Record proper release of Declaration of Trust by and between Syracuse Housing Authority and the United States of America, Secretary of Housing and Urban Development, dated June 9, 2017 and recorded in Book 5429, Page 441 in the Clerk's Office for Onondaga County, New York

18. Record proper release of Declaration of Trust by and between Syracuse Housing Authority and the United States of America, Secretary of Housing and Urban Development, recorded in Book 5421, Page 757 in the Clerk's Office for Onondaga County, New York, as amended by Amended Declaration of Trust recorded in Book 5425, Page 101 in the Clerk's Office for Onondaga County, New York.

19. The Company must be furnished prior to settlement for its review, a current ALTA/NSPS Survey certified to Gatehouse Title Agency, LLC and First American Title Insurance Company, with the current legal description of the property to be insured or the final policy will contain a standard survey exception.

20. The company requires an accurate legal description of subject property.

21. The Company will require a sworn Owner's Affidavit and Indemnity, acceptable to the Company, to be completed and duly executed.

22. Proof must be supplied to the Company that the exemption as stated on the tax search herein is still in full force and effect and that all of the persons entitled to said exemption are still entitled to said exemption and that no discounts were given for persons not entitled to the same.

23. At closing the certified owner(s) will be required to review the mortgage schedule contained in this title report and to execute an affidavit to the effect that all open mortgages affecting the property are contained herein.

24. An affidavit must be taken at closing stating that the owner has not received a notice to install or repair sidewalks or curbs on the premises. In the event a repair notice has been received, the purchaser must ascertain prior to closing whether or not the repair has been properly completed and all charges in connection therewith have been paid. Failure to comply with the repair requirements will result in a future lien against which the policy does not protect.

25. Possible New York State Realty Property Transfer Gains Tax and Credit Line Mortgage pursuant to Article 31-B and Article 253-B of the Tax Law to be considered and disposed of.

26. Tax law Section 663(d), effective 9/1/03 as revised, requires that a recording officer shall not record or accept for record any deed unless accompanied by a IT-2663 together with the payment of the estimated tax due, if any, by check made payable to “NYS INCOME TAX” or if the transaction is not subject to the filing and payment requirements of Section 663 because the seller is a resident individual, trust or estate, a TP-584 form which includes a completed certification by transfer or seller that this section is inapplicable to the transfer.

27. All parties, **including lenders**, must acknowledge that neither the underwriter nor its title agents can provide any estimate regarding the date when recordation of such title documents in the Public Records will be available. Satisfactory acknowledgments by lenders may be indicated through closing instructions or by email confirmation.

28. **NOTE:** If the tax search contained herein reflects open taxes, proof of payment is to be displayed at or prior to closing.

29. NOTE: The Company reserves the right to make additional requirements and/or exceptions upon review of the documents and instruments pertaining to the transaction and upon review of the facts and circumstances giving rise to the transaction, including, but not limited to, disclosure of the interested parties including purchasing and lending entities and upon examination of those items or instruments tendered in response to requirements set forth herein, and the Company, upon such examination and review, reserves the right, in its sole discretion, to amend, modify, delete or supplement the terms and provisions set forth in this commitment.

First American Title™	Certificate of Title
	ISSUED BY **First American Title Insurance Company**
Schedule BII	**TN0134-107-T**

File No.: TN0134-107-T

EXCEPTIONS

The policy will include as exceptions to the title the following matters unless they are disposed of to the satisfaction of the Company:

1. Rights of tenants or persons in possession, if any.

2. Taxes, tax liens, tax sales, water rates, sewer rents and assessments set forth herein.

3. Any state of facts which a guaranteed survey of current date would disclose.

4. There (is) are 0 open mortgage(s) of record. (See Mortgage Schedule herein)

5. Any state of facts which a guaranteed survey of current date would disclose. Until a guaranteed survey is received, policy will not insure courses, distances, and dimensions of subject premises or the bed of any street, road, or avenue passing through the same, and will except any facts such a survey or personal inspection would show.

6. Notwithstanding the recitation of acreage, if any, contained in Schedule A hereof, nothing herein contained shall be construed as a guarantee of the accuracy of the computation of such acreage or square footage. The Company does not insure the computation of area, square footage, or acreage of the Land.

7. If the premises to be insured herein are serviced by a water meter, a final meter reading must be obtained and a bill for meter charges must be submitted at the time of closing. In the absence of an actual reading and a water bill, policy will except all meter charges from the date of reading.

   NOTE: CLOSER SHALL NOT OMIT THIS EXCEPTION FOR FEE POLICY UNLESS AN ACTUAL BILL IS PRESENTED AT CLOSING.

8. Pending disbursement of the full proceeds of the loan secured by the insured mortgage described herein, this Policy insures only to the extent of the amount actually disbursed, but increases as disbursements are made in good faith and without knowledge of any defects in, or objections to the title, up to the face amount of the policy. At the time of each disbursement of the proceeds of the loan, title must be continued down to the date of each disbursement for possible liens or objections intervening between the date hereof and the date of each disbursement.

9. The tax search indicates that the premises described in Schedule A is benefited by a tax exemption that may terminate upon the transfer of title or death of said owner entitled to such exemption. The land then may become taxed, pro-rata, for the unexpired term of the tax year from the termination of the exemption. Policy will except loss or damage arising from the retroactive re-imposition of taxes from the termination of the exemption.

10. Any right, title, interest, estate, grant, easement, or reservation of subsurface areas of the land described in Schedule A, including but not limited to, any oil or gas rights, or minerals or mineral rights appearing in the Public Records and any rights of access to said oil or gas rights, or minerals or mineral rights for the purpose of mining, drillings, extraction or exploration.

SCHEDULE B
(Continued)

11. Policy excepts any loss, claim or damage which the insured may sustain by reason of any right or claim of title which has been or which may be asserted, of record or not, by or on behalf of any Indian tribe on the basis that the prior purported transfer or termination of aboriginal or other title held by the tribe was invalid by virtue of the Act of July 22, 1790, “An Act to Regulate Trade and Intercourse with the Indian Tribes” (Stat. 137, 138), and any subsequent re-enactment of the Act or any similar federal or state law.

12. Except variations between tax map and record description, if any.

13. Any right, title, interest, estate, grant, easement, or reservation of subsurface areas of the land described in Schedule A, including but not limited to, any oil or gas rights, or minerals or mineral rights appearing in the Public Records and any rights of access to said oil or gas rights, or minerals or mineral rights for the purpose of mining, drillings, extraction or exploration.

14. Underground Line Easement made April 5, 1981 by and between Syracuse Housing Authority and Viagra Vohawk Power Corporation, filed for record in Book 2862, Page 43.

15. Grant of Easement made April 22, 1944 by and between Syracuse Housing Authority and New York Telephone Company, filed for record in Book 3980, Page 196.

16. Easement and Conditions of Agreement made November 26, 2003 by and between Syracuse Housing Authority and Time Warner Entertainment, filed for record in Book 4812, Page 130.

NOTE: If the tax search contained herein reflects open taxes, proof of payment is to be displayed at or prior to closing.

NOTE: All Municipal, Departmental and Street Reports are **FOR INFORMATION ONLY**. They are not insured and this Company assumes no liability for the accuracy thereof. They will not be continued to the date of closing.

NOTE: If an assignment of mortgage is to be recorded there must be set forth in the assignment document or attached thereto and recorded as part thereof a statement under oath signed by the mortgagee or any other party to the transaction having knowledge of the facts (provided s/he asserts such knowledge), that the assignee is not acting as a nominee of the mortgagor and that the mortgage continues to secure a bona fide obligation.

NOTE: If there is a mortgage to be paid off at closing, please submit a current payoff letter in advance of closing in order to facilitate confirmation of amount and payoff procedures.

NOTE: Tax block and lot are to appear in the body of all closing instruments.

PLEASE NOTE: ALL CHECKS FOR MUNICIPAL TAXES MUST BE MADE PAYABLE TO Gatehouse Title Agency, LLC. WE WILL NOT ACCEPT DIRECT CHECKS TO THE RECEIVER OF TAXES OR THE MUNICIPALITY CONCERNED.

NOTE: If the transaction is a sale or transfer the Combined Real Estate Transfer Tax Return and Credit Line Mortgage Certificate (TP-584) is to be signed by ALL PARTIES.

NOTE: If a Power of Attorney or a Prior Executed Document is to be used for any purpose in the proposed transaction, it must be submitted for review at least two (2) days prior to closing. If the Power of Attorney or Prior Executed Document is produced at closing without prior written notice to this Company, the closing may be adjourned until such Power of Attorney or Prior Executed Document can be analyzed by this Company. Proof is required that same has not been revoked and is still in full force and effect and that the donor thereof is alive and competent at the time of execution and delivery of the documents made by the attorney-in-fact thereunder.

First American Title™	Certificate of Title
	ISSUED BY **First American Title Insurance Company**
Schedule A (Continued)	**TN0134-107-T**

File No.: TN0134-107-T

The Land referred to herein below is situated in the County of ONONDAGA, State of NEW YORK, and is described as follows:

Beginning at a point being the intersection of the east line of South Townsend Street with the south line of Jackson Street running thence east along the south line of Jackson Street to its intersection with the west line of South McBride Street; thence south along the west line of South McBride Street continued across Star Avenue to the intersection of the west line of South McBride Street with the north line of East Taylor Street; thence west along the north line of East Taylor Street to its intersection with the east line of South Townsend Street; thence north along the east line of South Townsend continued across Star Avenue to the point of intersection of the east line of South Townsend Street with the south line if Jackson Street at the point of beginning.

1101 Townsend St. S., Jackson St., Syracuse, NY 13202

1. Deed made from City of Syracuse, dated 02/07/1939, and recorded 01/24/1940 in Book 921, Page 290 in the Office of the Clerk of Onondaga County. Note: Re-record of Deed in Book 892, Page 449. (Covers premises under examination and more).

2. Deed made from City of Syracuse, dated 02/07/1939, and recorded 03/08/1939 in Book 892, Page 449 in the Office of the Clerk of Onondaga County. (Covers premises under examination and more).

3. Deed made from Elena L. Valigura, dated 09/24/1938, and recorded 09/27/1938 in Book 880, Page 1 in the Office of the Clerk of Onondaga County.

4. Deed made from Pesea Zaiman, individually and as executrix and trustee under the last will and testament of Hirsh Zaiman, dated 08/01/1938, and recorded 08/04/1938 in Book 875, Page 7 in the Office of the Clerk of Onondaga County.

5. Deed made from First Trust and Deposit Company, dated 07/29/1938, and recorded 08/02/1938 in Book 874, Page 398 in the Office of the Clerk of Onondaga County.

6. Deed made from First Trust and Deposit Company, dated 07/29/1938, and recorded 08/02/1938 in Book 874, Page 394 in the Office of the Clerk of Onondaga County.

7. Deed made from Albert E. Stone (unmarried), dated 07/27/1938, and recorded 07/29/1938 in Book 874, Page 205 in the Office of the Clerk of Onondaga County.

8. Deed made from Marx Orenstein, a widower, dated 07/06/1938, and recorded 07/26/1938 in Book 873, Page 493 in the Office of the Clerk of Onondaga County.

9. Deed made from Moses Aarons, a widower, dated 07/22/1938, and recorded 07/26/1938 in Book 873, Page 490 in the Office of the Clerk of Onondaga County.

10. Deed made from Effa J. Lawton, dated 07/06/1938, and recorded 07/20/1938 in Book 873, Page 223 in the Office of the Clerk of Onondaga County.

11. Deed made from Frances E. Bondy, dated 07/01/1938, and recorded 07/18/1938 in Book 873, Page 78 in the Office of the Clerk of Onondaga County.

12. Deed made from Lewis Manson and Libbie Manson, his wife, dated 07/14/1938, and recorded 07/18/1938 in Book 873, Page 72 in the Office of the Clerk of Onondaga County.

13. Deed made from Lewis Manson and Libbie Manson, his wife, dated 07/14/1938, and recorded 07/18/1938 in Book 873, Page 69 in the Office of the Clerk of Onondaga County.

14. Deed made from William S. Murphy and Harold S. Murphy, dated 07/11/1938, and recorded 07/12/1938 in Book 872, Page 225 in the Office of the Clerk of Onondaga County.

15. Deed made from Abraham Menter, dated 07/08/1938, and recorded 07/11/1938 in Book 872, Page 147 in the Office of the Clerk of Onondaga County.

16. Deed made from Hattie U. Singer, dated 07/06/1938, and recorded 07/09/1938 in Book 872, Page 64 in the Office of the Clerk of Onondaga County.

17. Deed made from William S. Murphy and Harold S. Murphy, dated 07/11/1938, and recorded 07/12/1938 in Book 872, Page 228 in the Office of the Clerk of Onondaga County.

18. Deed made from Joseph Samuels, dated 07/05/1938, and recorded 07/06/1938 in Book 871, Page 326 in the Office of the Clerk of Onondaga County.

19. Deed made from Leon Burdick, a widower, dated 07/05/1938, and recorded 07/06/1938 in Book 871, Page 329 in the Office of the Clerk of Onondaga County.

20. Deed made from Max Hare and Minnie Hare, his wife, dated 07/01/1938, and recorded 07/06/1938 in Book 871, Page 323 in the Office of the Clerk of Onondaga County.

21. Deed made from The Onondaga County Savings Bank, dated 06/28/1938, and recorded 07/01/1938 in Book 871, Page 154 in the Office of the Clerk of Onondaga County.

22. Deed made from The Onondaga County Savings Bank, dated 06/28/1938, and recorded 07/01/1938 in Book 871, Page 106 in the Office of the Clerk of Onondaga County.

DataTrace®
T. 516.663.0600 F. 657.205.3795 E. All.NY.Customer.Service@datatracetitle.com

Tax Search

TITLE #: TN0134-107 **DATE:** 8/30/2024

PREPARED FOR: Gatehouse Title Agency, LLC (GHOUSE) **ORDER ID:** 12558956

PREMISES:

1101 TOWNSEND ST S & JACKSON S, SYRACUSE

STATE: NY **COUNTY:** ONONDAGA **CITY:** SYRACUSE

SECTION: 095 **BLOCK:** 12 **LOT:** 01.0

ASSESSMENT:

ASSESSED OWNER(S): SYR HOUSING AUTHORITY PIONEER HOMES

PROPERTY CLASS: 411 **LAND:** 432,600 **STATE SWIS CODE:** 311500

SCHOOL DISTRICT: SYRACUSE **TOTAL:** 1,950,000

ACREAGE: NA **LOT SIZE:** 268.65X403.46 **BILL KEY:** 095.-12-01.0

2024/2025 CITY/SCHOOL TAX PERIOD 7/1/2024 - 6/30/2025

EXEMPTIONS:

SYR HOUSNG 1,950,000

BASE TAX AMOUNT WITHOUT EXEMPTIONS: **$55,919.10**

TOTAL TAX: **$809.56**

1ST QUARTER	DUE:	7/1/2024	**$202.39**	**PAID**
2ND QUARTER	DUE:	10/1/2024	**$202.39**	**OPEN**
3RD QUARTER	DUE:	1/1/2025	**$202.39**	**OPEN**
4TH QUARTER	DUE:	4/1/2025	**$202.39**	**OPEN**

CITY/SCHOOL TAX INCLUDES:

- SWEEPING $629.56
- COM SE SIDEWALK $180.00

RECOMMEND THAT CUSTOMER CONFIRM AT CLOSING THAT OWNER HAS NOT RECEIVED NOTICE OF SPECIAL ASSESSMENTS (I.E., SIDEWALK REPAIRS, LOT CLEARANCE, EMERGENCY REPAIRS, ETC.). SEARCH MAY NOT INCLUDE EXISTENCE OF SUCH NOTICES. EXEMPT PROPERTY RESTORED FACTORS (IF ANY) SHOWN ABOVE REPRESENT THE DIFFERENCE BETWEEN THE ACTUAL TAX SHOWN AND WHAT THE TAX WOULD HAVE BEEN HAD THERE BEEN NO EXEMPTION. RESTORED TAX IS FIGURED ON A PRO-RATA BASIS FROM DATE OF DEED TO END OF FISCAL YEAR OF EACH TAX SO AFFECTED. METHOD OF COLLECTION OF RESTORED TAX IS NOT UNIFORM FOR ALL MUNICIPALITIES. SEARCH DOES NOT INCLUDE LEVIES OF RESTORED TAXES NOT YET POSTED BY MUNICIPALITY. SOME ITEMS RETURNED MAY HAVE BEEN PAID BUT NOT OFFICIALY POSTED BY MUNICIPALITY. RECOMMEND THAT CUSTOMER OBTAINS RECEIPTS FOR SUCH ITEMS AT CLOSING. TAX DUE DATES MAY VARY ANNUALLY.RECOMMEND THAT CUSTOMER CONFIRM DUE DATES WITH THE APPROPRIATE MUNICIPALITY. SEARCH MAY NOT INCLUDE ITEMS NOT A LIEN UP TO THE DATE SHOWN. SEARCH DOES NOT INCLUDE ARREARS FILED AGAINST ANY NAME OTHER THAN THE ASSESSED OWNER AS SHOWN ABOVE. THE RETURNS ARE SPECIFIC TO SECTION, BLOCK AND LOT.

IMPORTANT NOTICE ABOUT SEARCH INFORMATION HEREIN

DATATRACE INFORMATION SERVICES, LLC. DISCLAIMS ANY AND ALL LIABILITY TO ANY PERSON OR ENTITY FOR THE PROPER PERFORMANCE OF SERVICES REFLECTING THE CONDITION OF TITLE TO REAL PROPERTY. THIS SEARCH WAS COMPILED FROM PUBLIC RECORDS MADE AVAILABLE FROM VARIOUS COUNTY AND MUNICIPAL OFFICES, AGENCIES AND DEPARTMENTS. THE SERVICES ARE PROVIDED "AS IS" WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESS OR IMPLIED, INCLUDING WITHOUT LIMITATION ANY WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES BASED ON COURSE OF DEALING OR USAGE IN TRADE OR ERRORS OR OMISSIONS RESULTING FROM NEGLIGENCE, MIS-INDEXING, MIS-POSTING OR ITEMS THAT ARE AFTER THE EFFECTIVE DATE OF THE SEARCH. THIS IS NOT AN INSURED SERVICE.THIS DISCLAIMER SUPERSEDES ALL PRIOR AND CONTEMPORANEOUS UNDERSTANDINGS. THE SERVICES ARE EXCLUSIVELY FOR THE DATATRACE CLIENT AND NOT FOR THE BENEFIT OF ANY THIRD PARTIES.

Continued..

DataTrace®
T. 516.663.0600 F. 657.205.3795 E. All.NY.Customer.Service@datatracetitle.com

2024 COUNTY TAX PERIOD 1/1/2024 - 12/31/2024

EXEMPTIONS:

SYR HOUSNG 1,950,000

BASE TAX AMOUNT WITHOUT EXEMPTIONS: **$55,422.54**

TOTAL TAX: **$33,814.98**

1ST QUARTER	DUE:	1/1/2024	**$8,453.76**	**PAID**
2ND QUARTER	DUE:	4/1/2024	**$8,453.74**	**PAID**
3RD QUARTER	DUE:	7/1/2024	**$8,453.74**	**PAID**
4TH QUARTER	DUE:	10/1/2024	**$8,453.74**	**OPEN**

ARREARS NONE FOUND

ACCOUNT TYPE: WATER/SEWER

DISTRICT: CITY OF SYRACUSE

ACCOUNT #: 09500C165700
AMOUNT: $2,224.16 OPEN

PERIOD COVERED
PERIOD BEGIN DATE: 4/16/2024
PERIOD END DATE: 7/30/2024

NEXT BILL OUT 11/18/2024

ACCOUNT #: 09500C165701
AMOUNT: $5,030.68 OPEN

PERIOD COVERED
PERIOD BEGIN DATE: 4/16/2024
PERIOD END DATE: 7/30/2024

NEXT BILL OUT 11/18/2024

NOTE: FINAL READ/ UP-TO-DATE BILL OR RECEIPT MUST BE PRODUCED AT CLOSING. SUBJECT TO PRIOR CHARGES NOT ENTERED AND SUBSEQUENT CHARGES SINCE DATE OF LAST READING.

SUBJECT TO CONTINUATION PRIOR TO CLOSING.

DataTrace®
T. 516.663.0600 F. 657.205.3795 E. All.NY.Customer.Service@datatracetitle.com

PAYMENT INFORMATION:

COUNTY TAX COLLECTOR
ONONDAGA COUNTY
County Municipal
421 Montgomery Street
Syracuse , NY 13202
PHONE: (315) 435-3346

CITY/SCHOOL TAX COLLECTOR
CITY OF SYRACUSE
Receiver of Taxes
233 East Washington Street
Room 122
Syracuse , NY 13202
PHONE: 3154488310

COUNTY TAX COLLECTOR
CITY OF SYRACUSE
233 East Washington Street
Room 122
Syracuse , NY 13202
PHONE: 3154488310

It is recommended you contact the above collector(s) prior to sending payment to confirm taxes are still payable to the above location(s).

For tax payment information visit: http://orps1.orpts.ny.gov/cfapps/MuniPro/swis/

The above is provided for informational purposes only. There is no liability assumed.

DataTrace®
T. 516.663.0600 F. 657.205.3795 E. All.NY.Customer.Service@datatracetitle.com

Street Maintenance Report

TITLE #: TN0134-107 **DATE:** 8/30/2024

PREPARED FOR: Gatehouse Title Agency, LLC (GHOUSE) **ORDER ID:** 12558956

PREMISES:

1101 TOWNSEND ST S & JACKSON S, SYRACUSE

State: NY **County:** ONONDAGA **City:** SYRACUSE

Section: 095 **Block:** 12 **Lot:** 01.0

DEPARTMENT OF HIGHWAYS

Please be advised that the above-mentioned street is:

A public road.

IMPORTANT NOTICE ABOUT SEARCH INFORMATION HEREIN

DATATRACE INFORMATION SERVICES, LLC DISCLAIMS ANY AND ALL LIABILITY TO ANY PERSON OR ENTITY FOR THE PROPER PERFORMANCE OF SERVICES REFLECTING THE CONDITION OF TITLE TO REAL PROPERTY.THIS SEARCH WAS COMPILED FROM PUBLIC RECORDS MADE AVAILABLE FROM VARIOUS COUNTY AND MUNICIPAL OFFICES, AGENCIES AND DEPARTMENTS. THE SERVICES ARE PROVIDED "AS IS" WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESS OR IMPLIED, INCLUDING WITHOUT LIMITATION ANY WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES BASED ON COURSE OF DEALING OR USAGE IN TRADE OR ERRORS OR OMISSIONS RESULTING FROM NEGLIGENCE, MIS-INDEXING, MIS-POSTING OR ITEMS THAT ARE AFTER THE EFFECTIVE DATE OF THE SEARCH.THIS IS NOT AN INSURED SERVICE.THIS DISCLAIMER SUPERSEDES ALL PRIOR AND CONTEMPORANEOUS UNDERSTANDINGS. THE SERVICES ARE EXCLUSIVELY FOR DATATRACE CLIENT AND NOT FOR THE BENEFIT OF ANY THIRD PARTIES

DataTrace®
T. 516.663.0600 F. 657.205.3795 E. All.NY.Customer.Service@datatracetitle.com

Patriot Search

TITLE #: TN0134-107 **DATE:** 8/30/2024

PREPARED FOR: Gatehouse Title Agency, LLC (GHOUSE) **ORDER ID:** 12558956

NAME OF INDIVIDUAL, CORPORATION, OR BUSINESS

EAST ADAMS PHASE VI LP

A search has been made of the list of "Specially Designated Nationals And Blocked Persons" ("SDN") maintained by the Office Of Foreign Assets Control, U.S. Department Of The Treasury, Pursuant To Executive Order 13224, as amended by Executive Order 13268, as well as "The Consolidated Sanctions List" that includes the list of "Foreign Sanctions Evaders" ("Non-SDN") pursuant to Executive Order 13608 and maintained by the Office Of Foreign Assets Control ("OFAC"), U.S. Department Of The Treasury and reports the following findings with respect to the name listed above as 8/28/2024 ("SDN") and 8/20/2024 ("Non-SDN").

There is **NO RECORD** found for the above mentioned individual, corporation, or business.

IMPORTANT NOTICE ABOUT SEARCH INFORMATION HEREIN

DATATRACE INFORMATION SERVICES, LLC. DISCLAIMS ANY AND ALL LIABILITY TO ANY PERSON OR ENTITY FOR THE PROPER PERFORMANCE OF SERVICES AND SEARCHES HEREIN.THIS SEARCH WAS COMPILED FROM PUBLIC RECORDS MADE AVAILABLE FROM VARIOUS COUNTY AND MUNICIPAL OFFICES, AGENCIES AND DEPARTMENTS. THE SERVICES ARE PROVIDED "AS IS" WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESS OR IMPLIED, INCLUDING WITHOUT LIMITATION ANY WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES BASED ON COURSE OF DEALING OR USAGE IN TRADE OR ERRORS OR OMISSIONS RESULTING FROM NEGLIGENCE, MIS-INDEXING, MIS-POSTING OR ITEMS THAT ARE AFTER THE EFFECTIVE DATE OF THE SEARCH. THIS IS NOT AN INSURED SERVICE. THIS DISCLAIMER SUPERSEDES ALL PRIOR AND CONTEMPORANEOUS UNDERSTANDINGS. THE SERVICES ARE EXCLUSIVELY FOR THE DATATRACE CLIENT AND NOT FOR THE BENEFIT OF ANY THIRD PARTIES.

DataTrace®
T. 516.663.0600 F. 657.205.3795 E. All.NY.Customer.Service@datatracetitle.com

Patriot Search

TITLE #: TN0134-107 **DATE:** 10/15/2024

PREPARED FOR: Gatehouse Title Agency, LLC (GHOUSE) **ORDER ID:** 12558956

NAME OF INDIVIDUAL, CORPORATION, OR BUSINESS

SYRACUSE HOUSING AUTHORITY

A search has been made of the list of "Specially Designated Nationals And Blocked Persons" ("SDN") maintained by the Office Of Foreign Assets Control, U.S. Department Of The Treasury, Pursuant To Executive Order 13224, as amended by Executive Order 13268, as well as "The Consolidated Sanctions List" that includes the list of "Foreign Sanctions Evaders" ("Non-SDN") pursuant to Executive Order 13608 and maintained by the Office Of Foreign Assets Control ("OFAC"), U.S. Department Of The Treasury and reports the following findings with respect to the name listed above as 10/11/2024 ("SDN") and 9/30/2024 ("Non-SDN").

There is **NO RECORD** found for the above mentioned individual, corporation, or business.

IMPORTANT NOTICE ABOUT SEARCH INFORMATION HEREIN

DATATRACE INFORMATION SERVICES, LLC. DISCLAIMS ANY AND ALL LIABILITY TO ANY PERSON OR ENTITY FOR THE PROPER PERFORMANCE OF SERVICES AND SEARCHES HEREIN.THIS SEARCH WAS COMPILED FROM PUBLIC RECORDS MADE AVAILABLE FROM VARIOUS COUNTY AND MUNICIPAL OFFICES, AGENCIES AND DEPARTMENTS. THE SERVICES ARE PROVIDED "AS IS" WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESS OR IMPLIED, INCLUDING WITHOUT LIMITATION ANY WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES BASED ON COURSE OF DEALING OR USAGE IN TRADE OR ERRORS OR OMISSIONS RESULTING FROM NEGLIGENCE, MIS-INDEXING, MIS-POSTING OR ITEMS THAT ARE AFTER THE EFFECTIVE DATE OF THE SEARCH. THIS IS NOT AN INSURED SERVICE. THIS DISCLAIMER SUPERSEDES ALL PRIOR AND CONTEMPORANEOUS UNDERSTANDINGS. THE SERVICES ARE EXCLUSIVELY FOR THE DATATRACE CLIENT AND NOT FOR THE BENEFIT OF ANY THIRD PARTIES.

Gatehouse Title Agency, LLC

File No. TN0134-107-T

M O R T G A G E S

DISPOSITION

NONE OF RECORD

Appendix E Historical Resources

Appendix E Historical Records

Historical Aerial Photographs

East Adams Redevelopment - Phase 6 Area

100 Raddison Court

Syracuse, NY 13202

Inquiry Number: 8026566.11

June 23, 2025

The EDR Aerial Photo Decade Package

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

EDR Aerial Photo Decade Package

06/23/25

Site Name:

East Adams Redevelopment - I
100 Raddison Court
Syracuse, NY 13202
EDR Inquiry # 8026566.11

Client Name:

Langan
368 Ninth Avenue, 8th Floor
New York, NY 10001-2727
Contact: Lexi Haley

Environmental Data Resources, Inc. (EDR) Aerial Photo Decade Package is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's professional researchers provide digitally reproduced historical aerial photographs, and when available, provide one photo per decade.

Search Results:

Year	Scale	Details	Source
2022	1"=500'	Flight Year: 2022	USDA/NAIP
2019	1"=500'	Flight Year: 2019	USDA/NAIP
2015	1"=500'	Flight Year: 2015	USDA/NAIP
2011	1"=500'	Flight Year: 2011	USDA/NAIP
2008	1"=500'	Flight Year: 2008	USDA/NAIP
1995	1"=500'	Acquisition Date: March 27, 1995	USGS/DOQQ
1988	1"=500'	Flight Date: October 31, 1988	NYDOT
1986	1"=500'	Flight Date: April 14, 1986	USDA
1978	1"=500'	Flight Date: September 13, 1978	USDA
1966	1"=500'	Flight Date: July 01, 1966	USDA
1959	1"=500'	Flight Date: June 15, 1959	USDA
1951	1"=500'	Flight Date: October 15, 1951	USDA
1938	1"=500'	Flight Date: September 05, 1938	USDA

When delivered electronically by EDR, the aerial photo images included with this report are for ONE TIME USE ONLY. Further reproduction of these aerial photo images is prohibited without permission from EDR. For more information contact your EDR Account Executive.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT.

Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2025 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

INQUIRY #: 8026566.11
YEAR: 2022
= 500'
N
EDR

INQUIRY #: 8026566.11

YEAR: 2019

= 500'

N

EDR

INQUIRY #: 8026566.11
YEAR: 2015
= 500'
N
EDR

INQUIRY #: 8026566.11
YEAR: 2011
= 500'
N
EDR

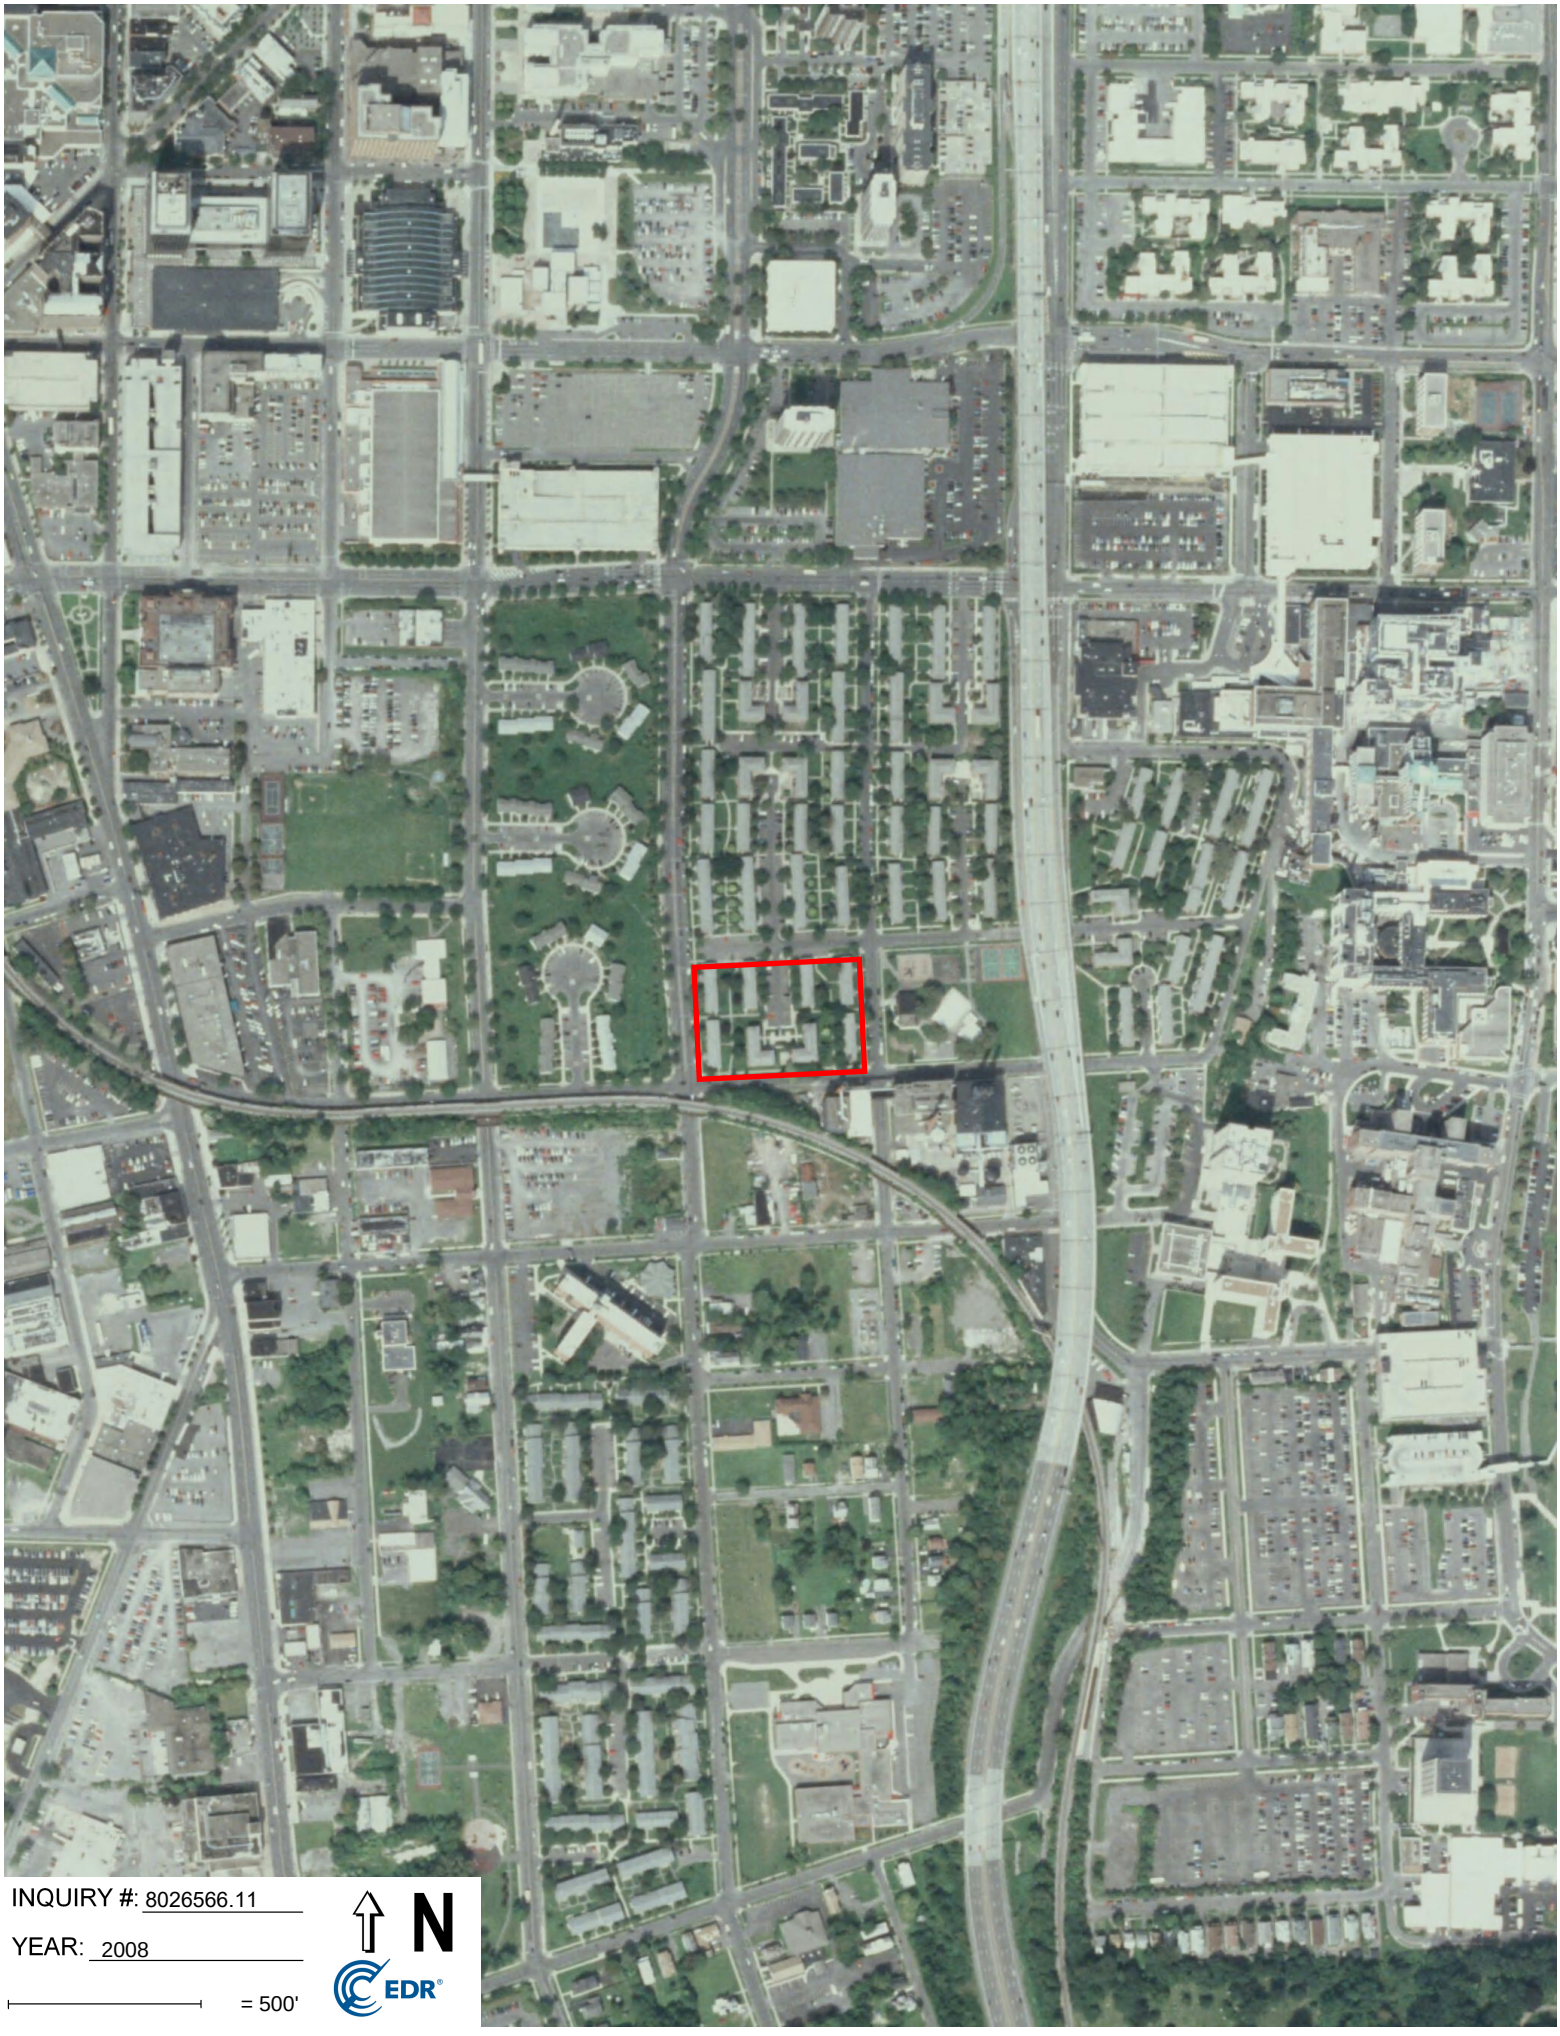
INQUIRY #: 8026566.11
YEAR: 2008
= 500'
N
EDR

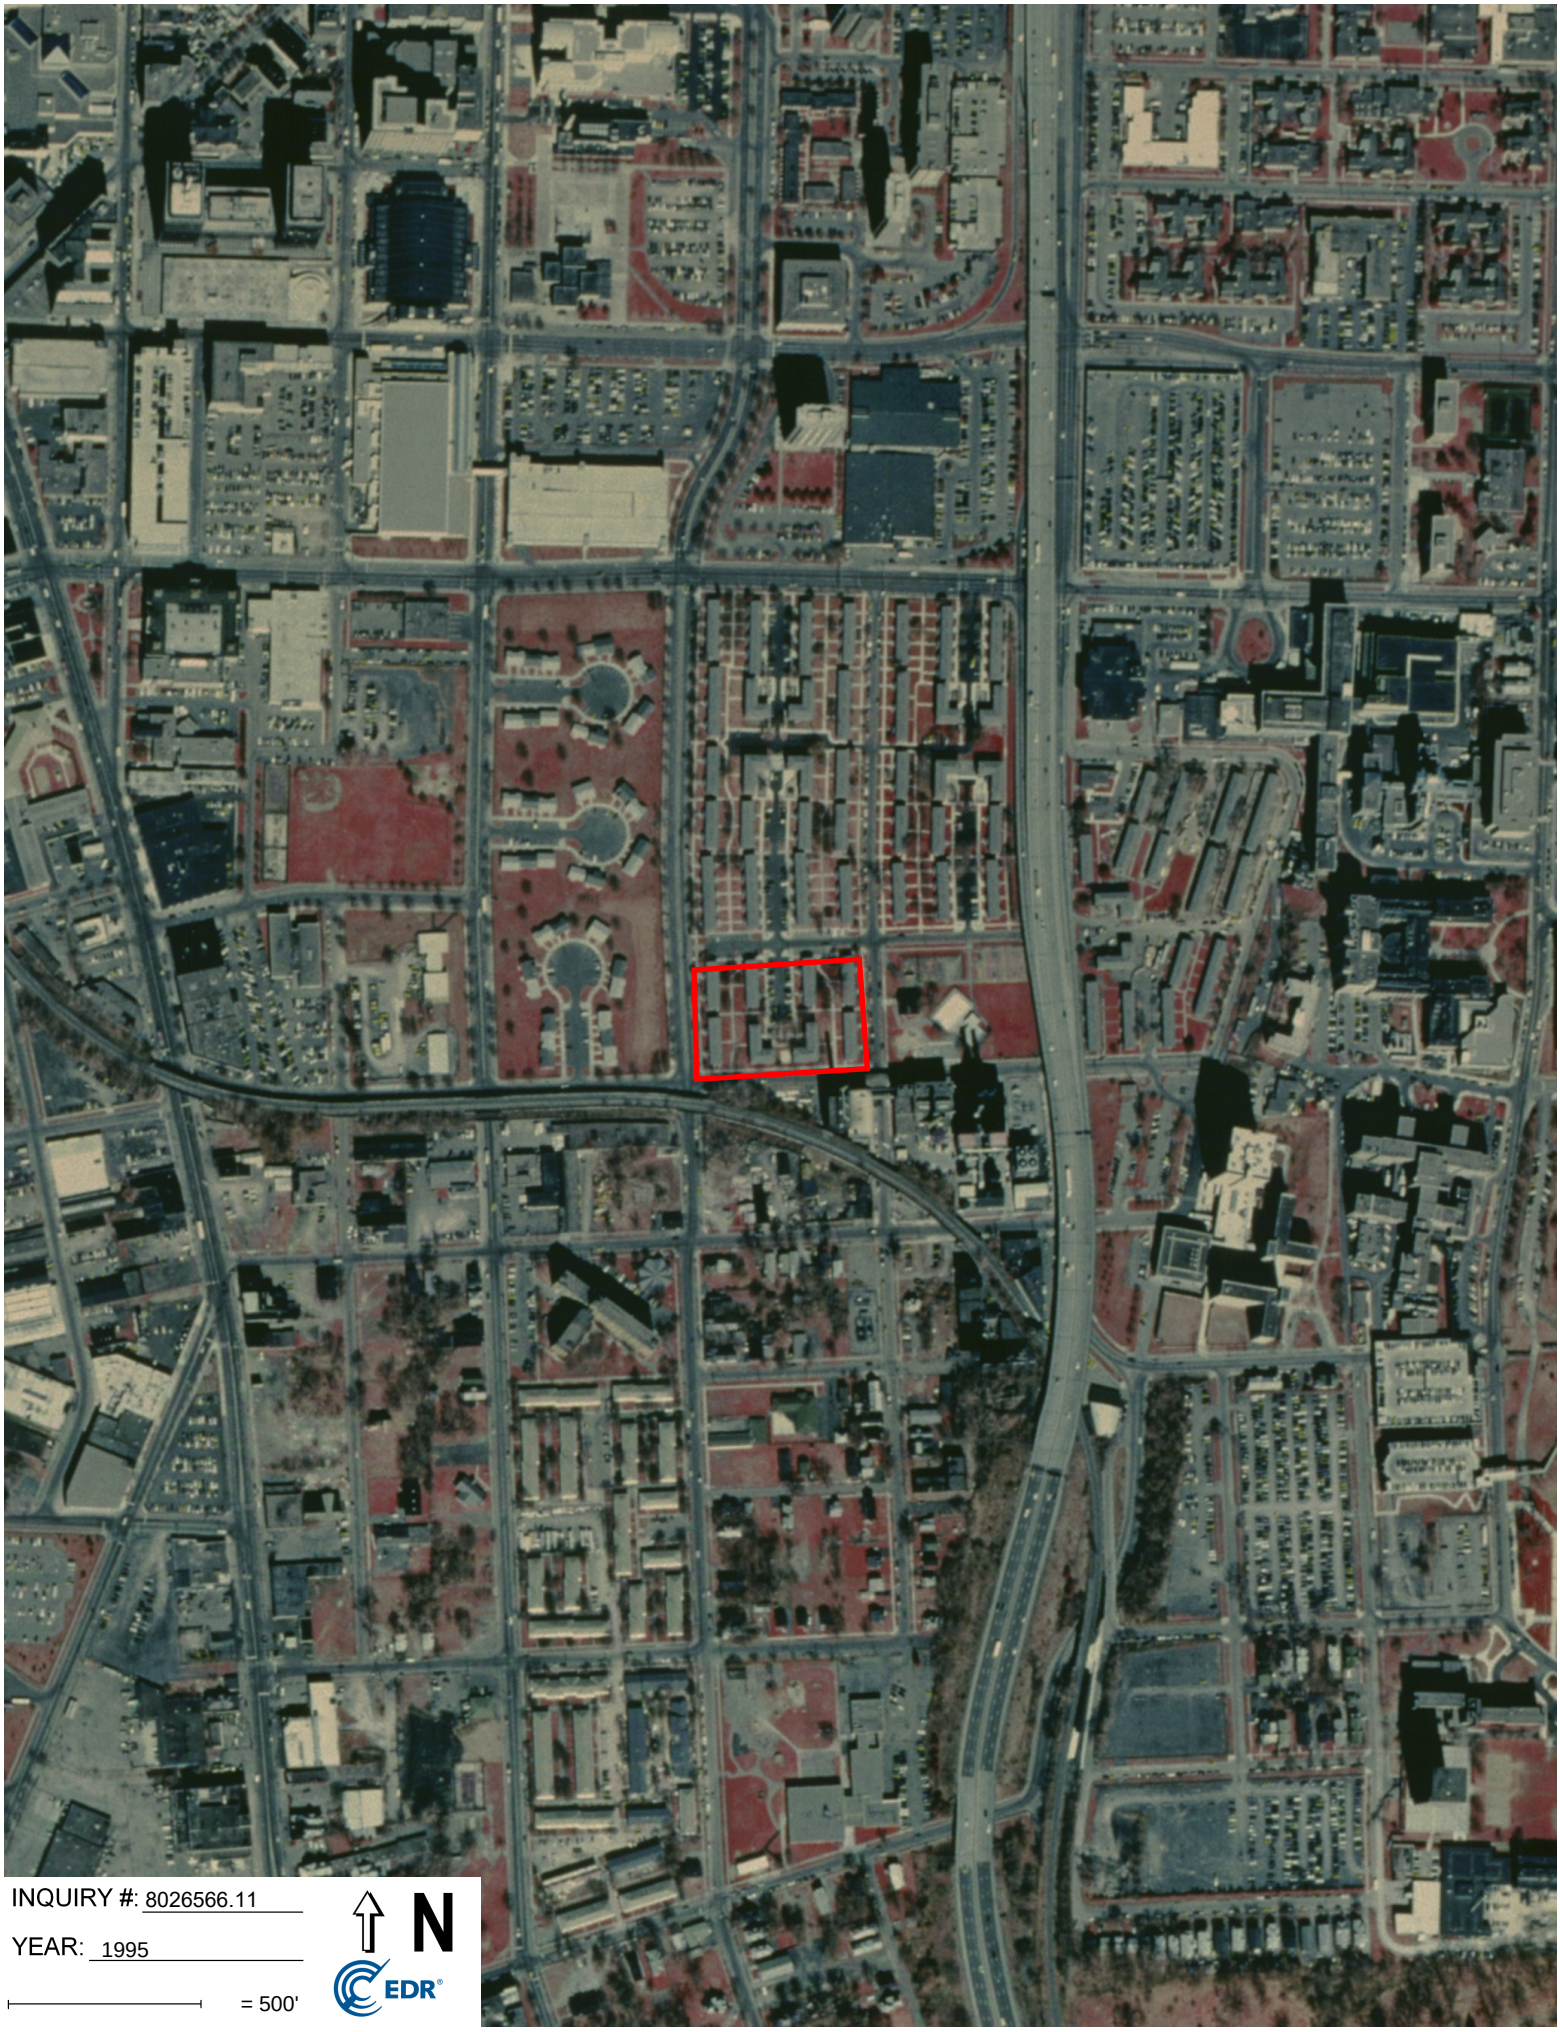

INQUIRY #: 8026566.11

YEAR: 1995

= 500'

N

EDR

INQUIRY #: 8026566.11

YEAR: 1988

= 500'

N

EDR

INQUIRY #: 8026566.11

YEAR: 1986

= 500'

N

EDR

INQUIRY #: 8026566.11
YEAR: 1978
= 500'
N
EDR

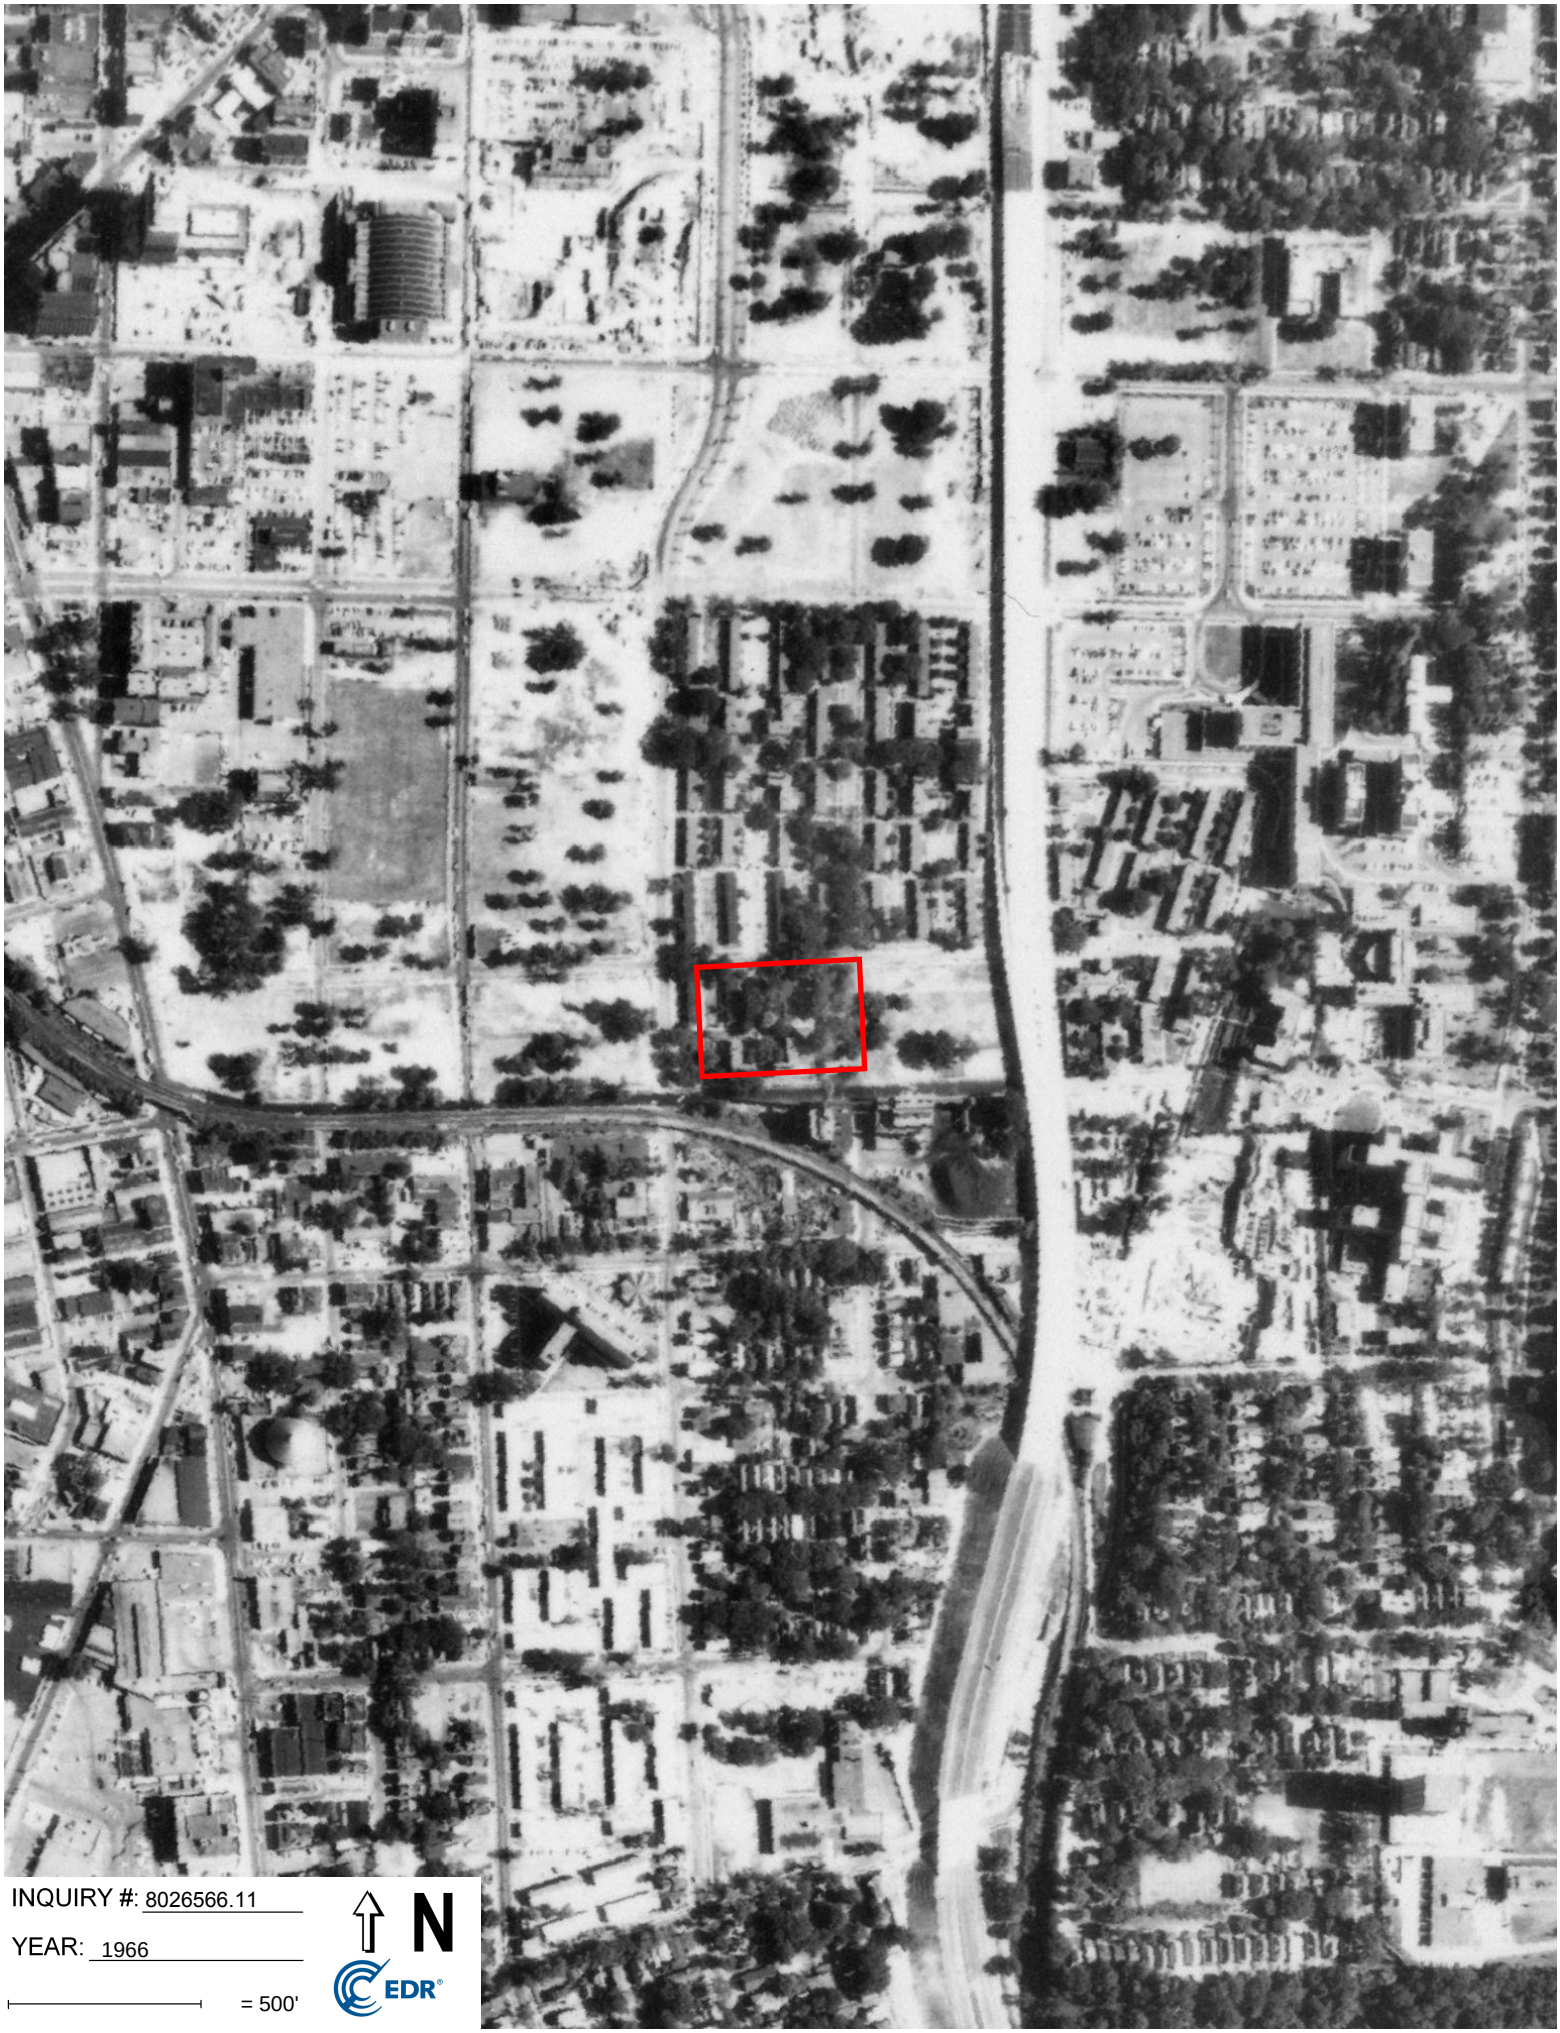

INQUIRY #: 8026566.11

YEAR: 1966

= 500'

N

EDR

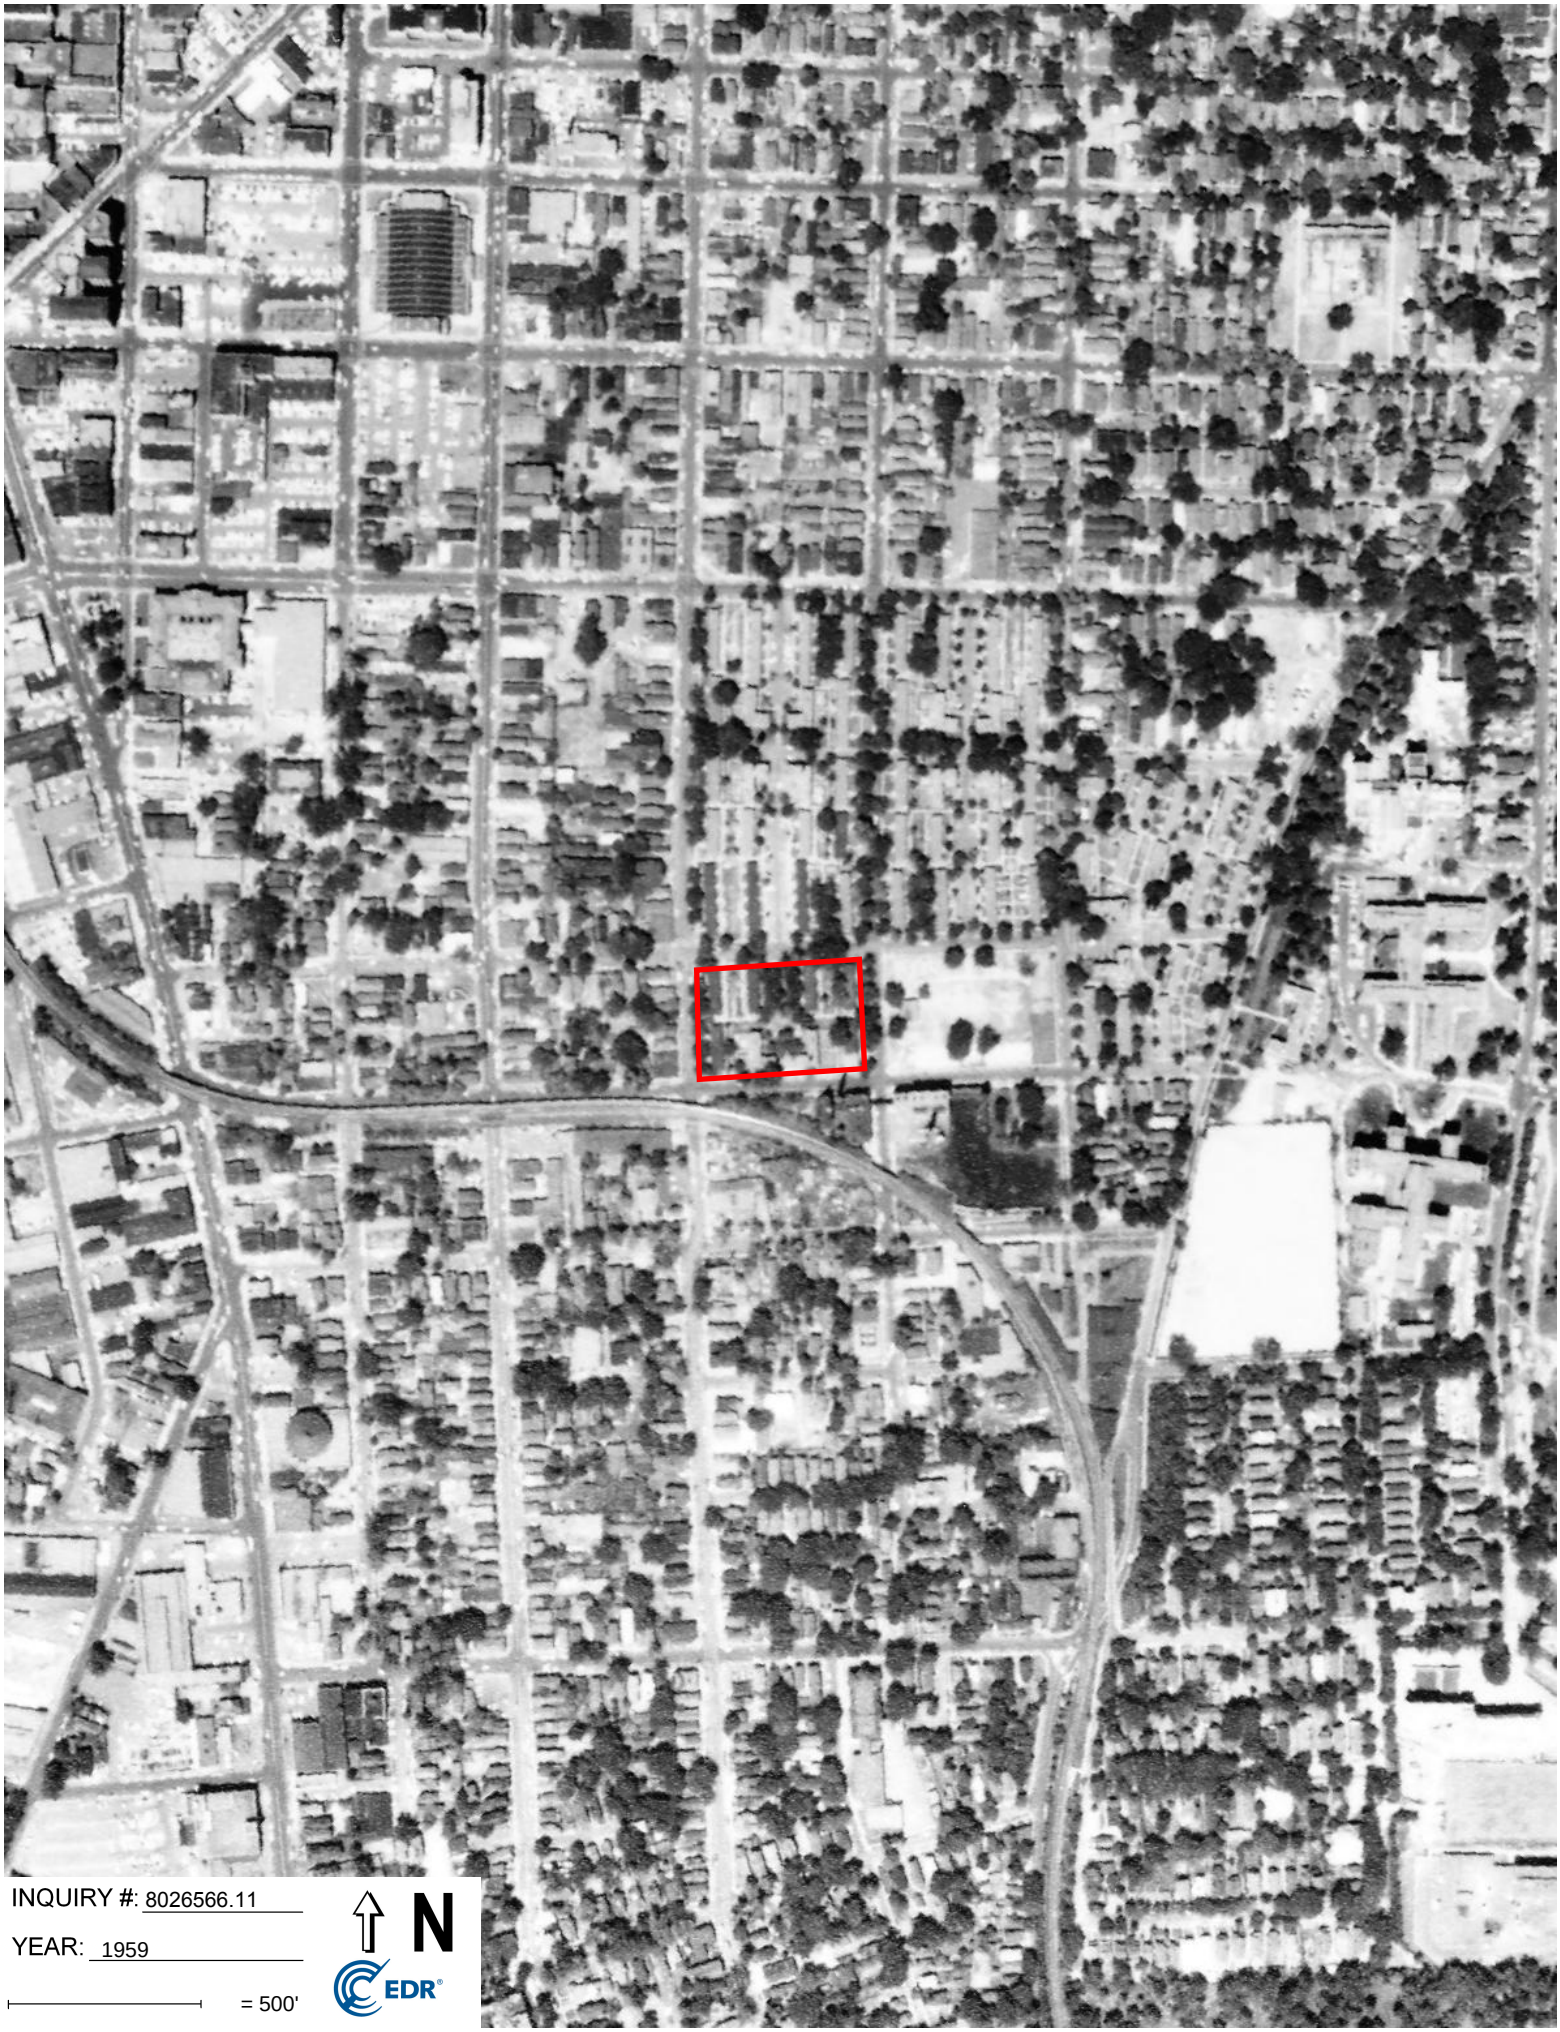
INQUIRY #: 8026566.11
YEAR: 1959
= 500'
N
EDR

INQUIRY #: 8026566.11

YEAR: 1951

= 500'

N

EDR

INQUIRY #: 8026566.11
YEAR: 1938
= 500'
N
EDR

Historical Topographic Maps

East Adams Redevelopment - Phase 6 Area

100 Raddison Court

Syracuse, NY 13202

Inquiry Number: 8026566.4

June 23, 2025

EDR Historical Topo Map Report

with QuadMatch™

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

EDR Historical Topo Map Report

06/23/25

Site Name:	Client Name:
East Adams Redevelopment - I	Langan
100 Raddison Court	368 Ninth Avenue, 8th Floor
Syracuse, NY 13202	New York, NY 10001-2727
EDR Inquiry # 8026566.4	Contact: Lexi Haley

EDR Topographic Map Library has been searched by EDR and maps covering the target property location as provided by Langan were identified for the years listed below. EDR's Historical Topo Map Report is designed to assist professionals in evaluating potential liability on a target property resulting from past activities. EDRs Historical Topo Map Report includes a search of a collection of public and private color historical topographic maps, dating back to the late 1800s.

Search Results:		*Coordinates:*	
P.O.#	170859701	**Latitude:**	43.039903 43° 2' 24" North
Project:	EA Redevelopment - Phase 6	**Longitude:**	-76.144788 -76° 8' 41" West
		UTM Zone:	Zone 18 North
		UTM X Meters:	406750.19
		UTM Y Meters:	4765881.83
		Elevation:	402.00' above sea level

Maps Provided:

2019	1938, 1939
2016	1898
2013	1895
1978	
1973, 1977	
1957, 1958	
1947	
1939, 1943	

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT. Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2025 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

Topo Sheet Key

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

2019 Source Sheets

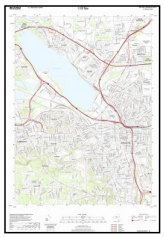

Syracuse West
2019
7.5-minute, 24000

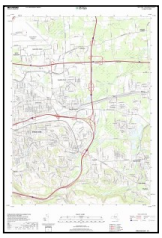

Syracuse East
2019
7.5-minute, 24000

2016 Source Sheets

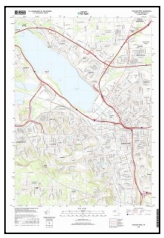

Syracuse West
2016
7.5-minute, 24000

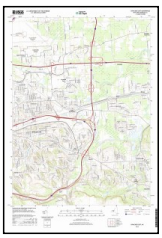

Syracuse East
2016
7.5-minute, 24000

2013 Source Sheets

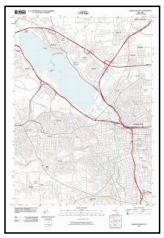

Syracuse West
2013
7.5-minute, 24000

Syracuse East
2013
7.5-minute, 24000

1978 Source Sheets

Syracuse East
1978
7.5-minute, 24000
Aerial Photo Revised 1976

Syracuse West
1978
7.5-minute, 24000
Aerial Photo Revised 1976

Topo Sheet Key

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

1973, 1977 Source Sheets

Syracuse West
1973
7.5-minute, 24000
Aerial Photo Revised 1972

Syracuse East
1977
7.5-minute, 24000
Aerial Photo Revised 1972

1957, 1958 Source Sheets

Syracuse East
1957
7.5-minute, 24000
Aerial Photo Revised 1956

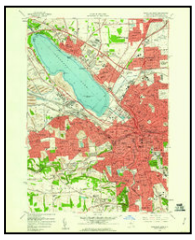

Syracuse West
1958
7.5-minute, 24000
Aerial Photo Revised 1956

1947 Source Sheets

Syracuse West
1947
7.5-minute, 31680

1939, 1943 Source Sheets

Syracuse West
1939
7.5-minute, 31680

Syracuse East
1943
7.5-minute, 31680

Topo Sheet Key

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

1938, 1939 Source Sheets

Syracuse East
1938
7.5-minute, 24000

1898 Source Sheets

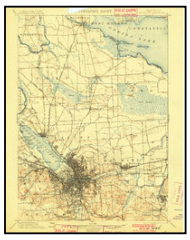

Syracuse
1898
15-minute, 62500

1895 Source Sheets

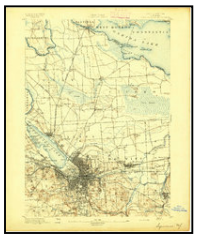

Syracuse
1895
15-minute, 62500

Historical Topo Map

2019

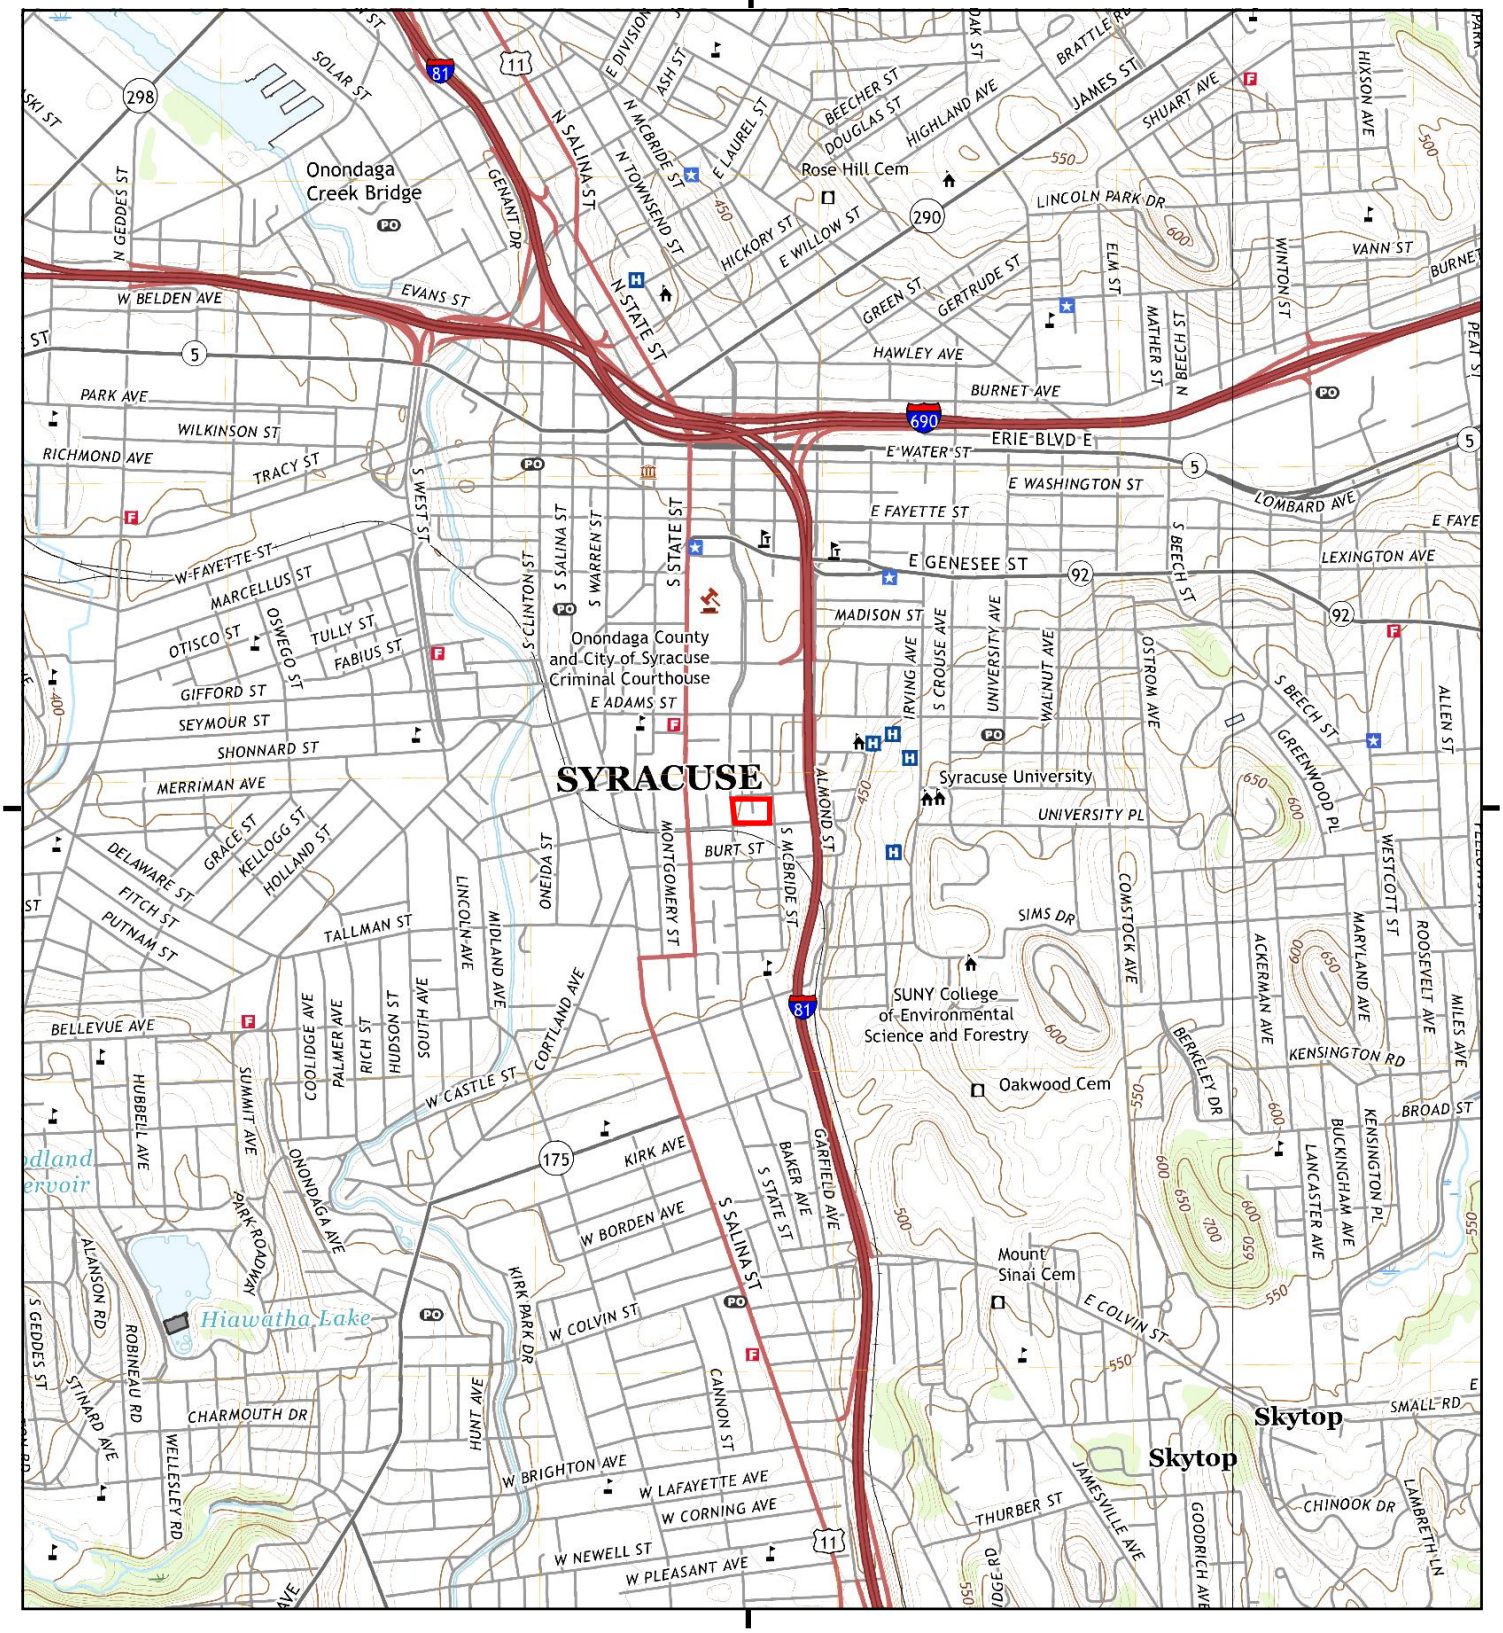

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Syracuse West, 2019, 7.5-minute
E, Syracuse East, 2019, 7.5-minute

SITE NAME: East Adams Redevelopment - Phase 6 Al
ADDRESS: 100 Raddison Court
Syracuse, NY 13202
CLIENT: Langan

N

Historical Topo Map

2016

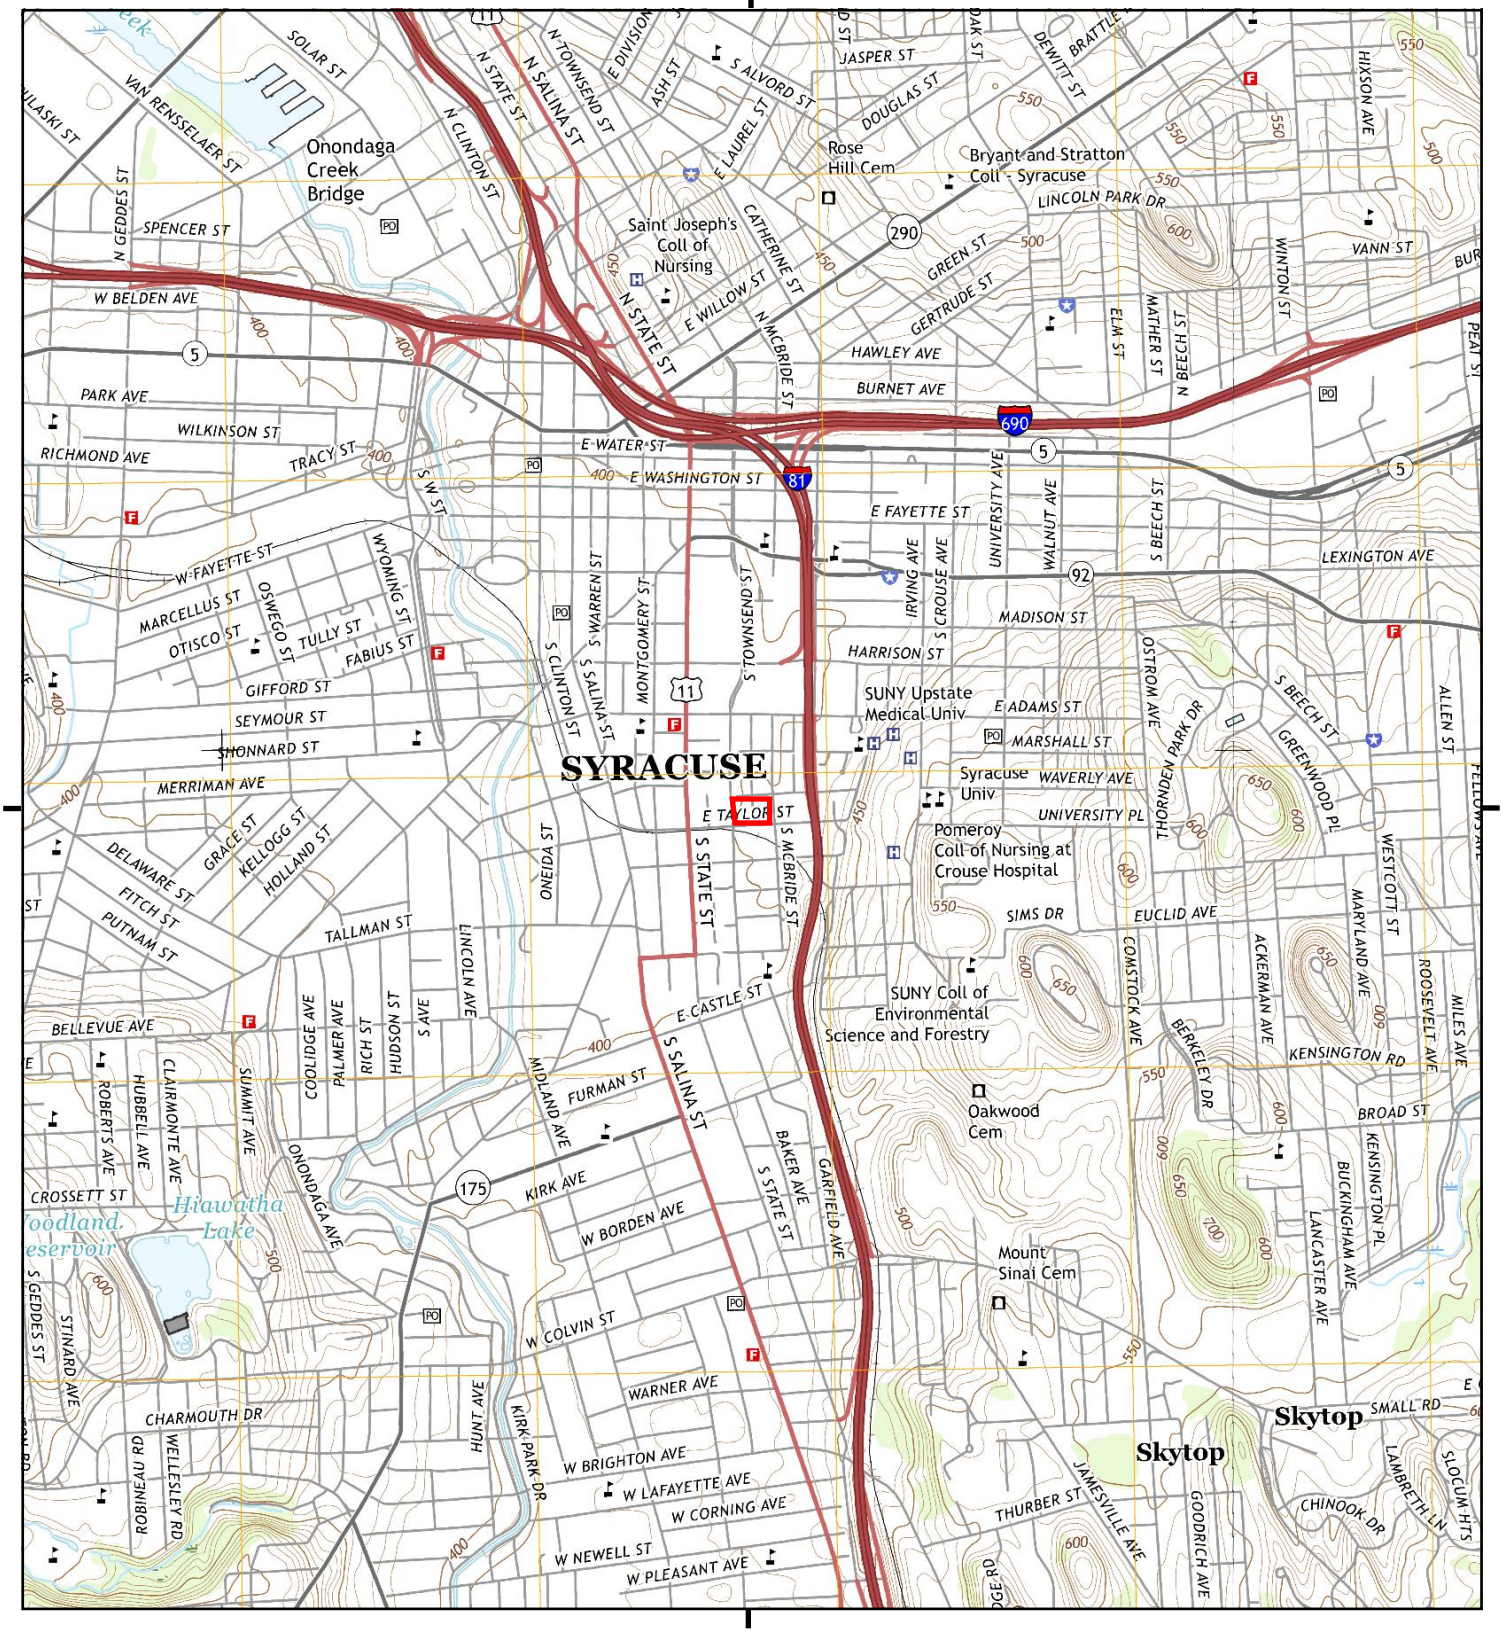

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Syracuse West, 2016, 7.5-minute
E, Syracuse East, 2016, 7.5-minute

SITE NAME: East Adams Redevelopment - Phase 6 Al
ADDRESS: 100 Raddison Court
Syracuse, NY 13202
CLIENT: Langan

N

Historical Topo Map

2013

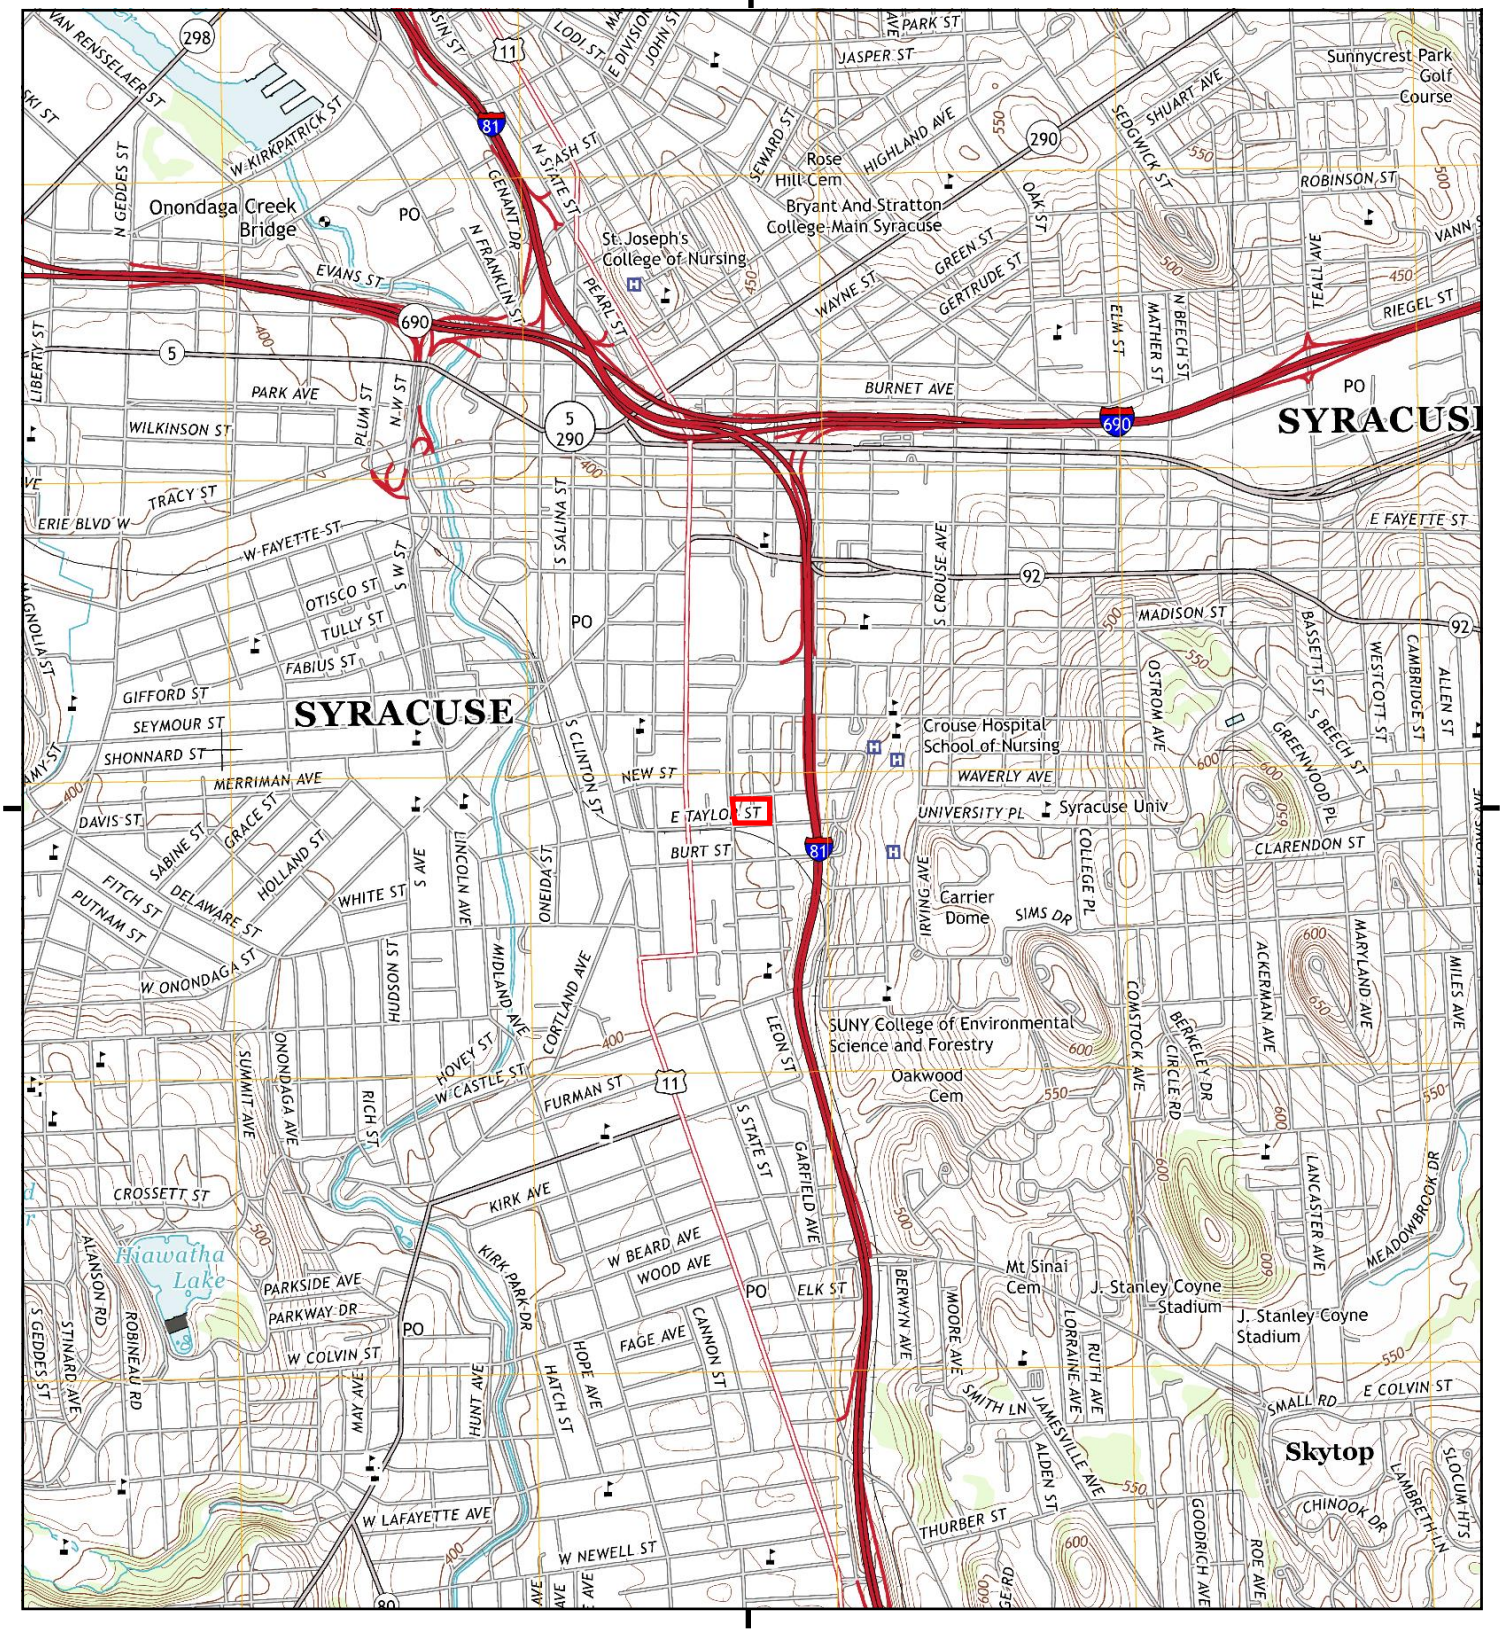

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

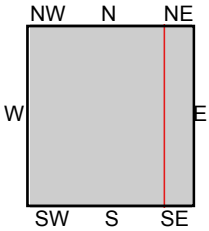

TP, Syracuse West, 2013, 7.5-minute
E, Syracuse East, 2013, 7.5-minute

SITE NAME: East Adams Redevelopment - Phase 6 A
ADDRESS: 100 Raddison Court
Syracuse, NY 13202
CLIENT: Langan

N

Historical Topo Map

1978

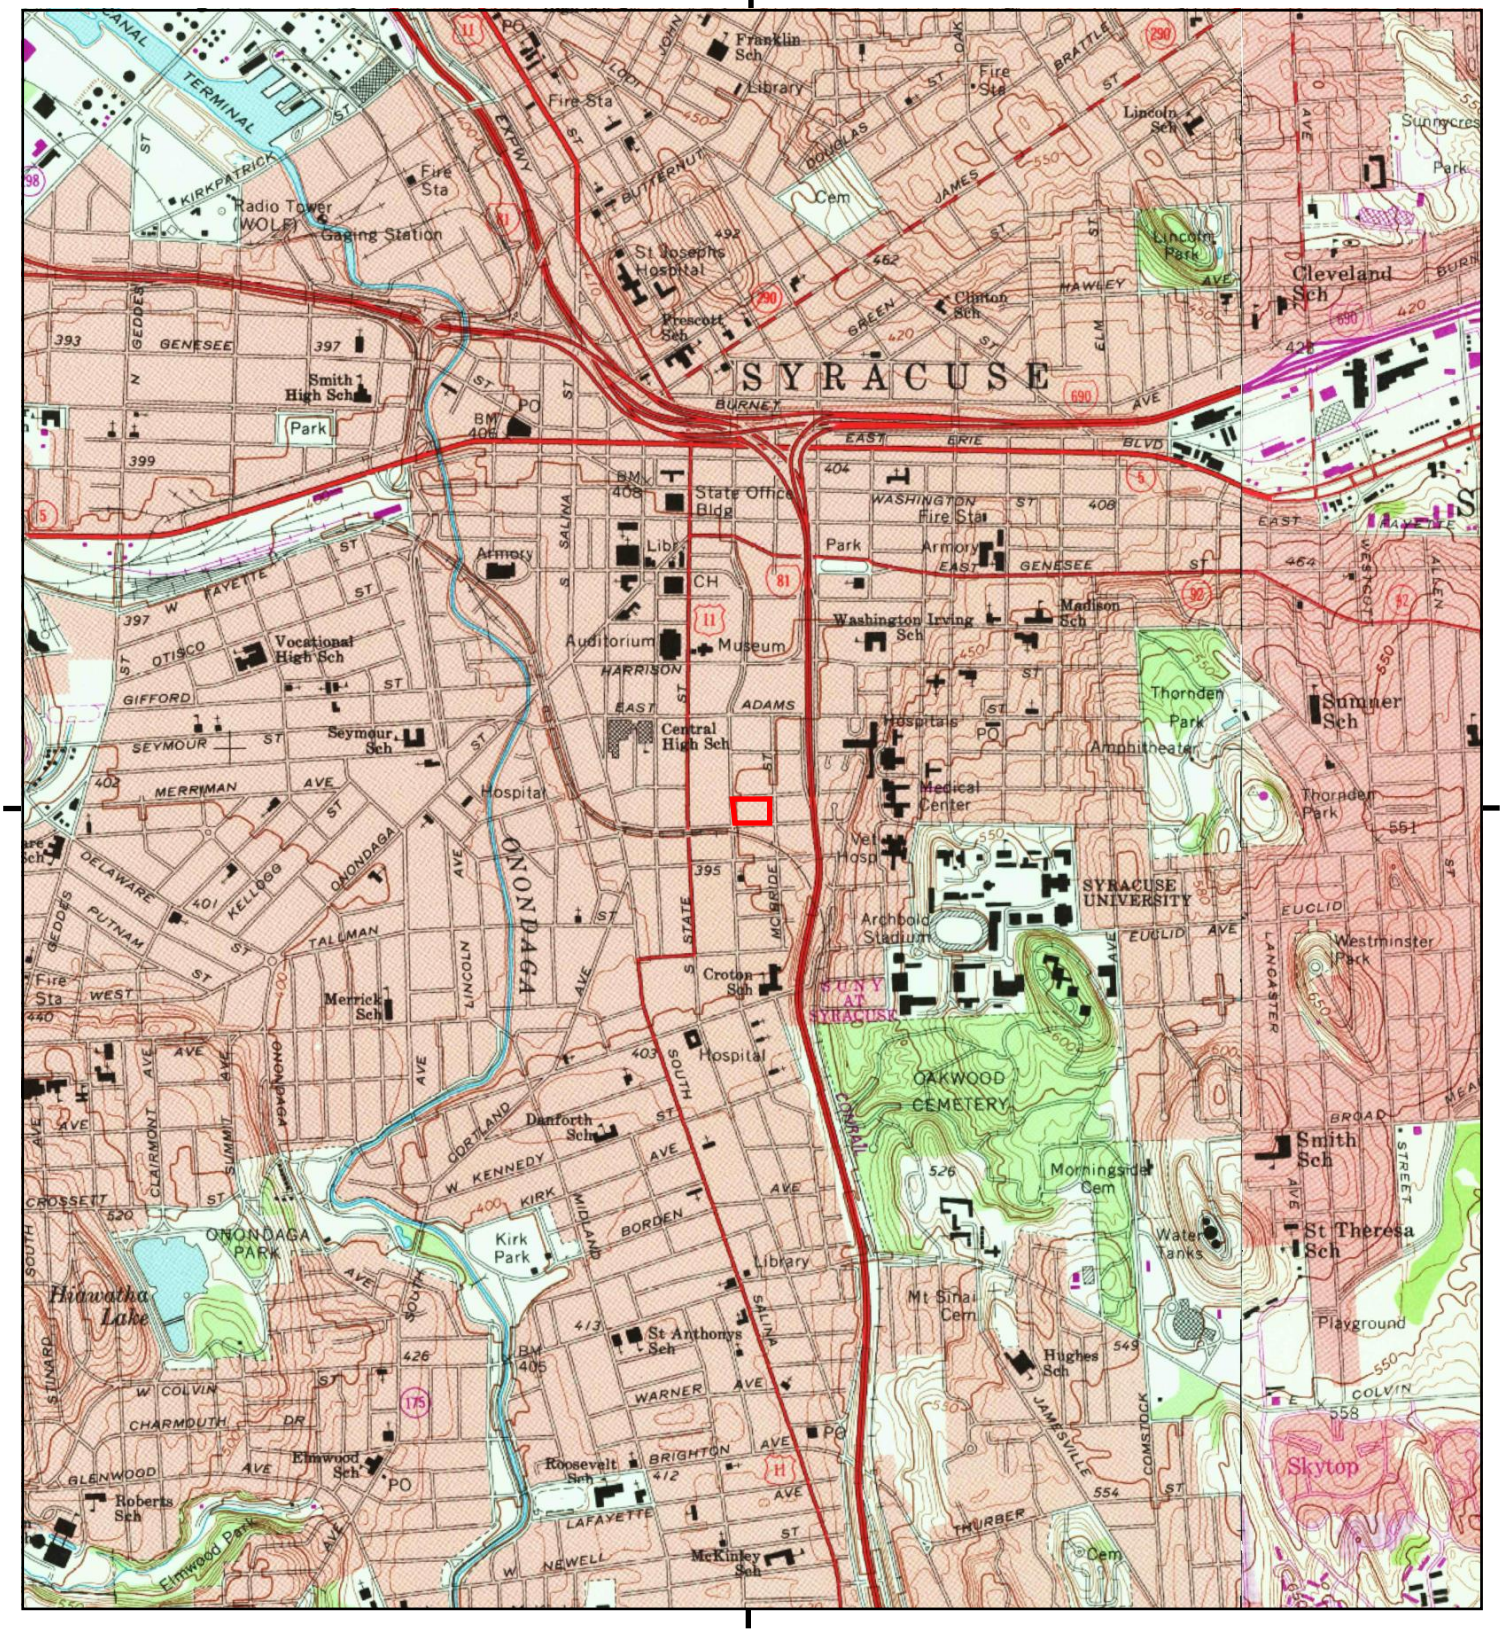

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

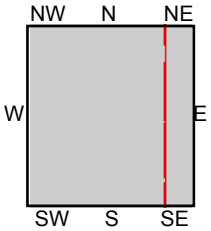

TP, Syracuse West, 1978, 7.5-minute
E, Syracuse East, 1978, 7.5-minute

SITE NAME: East Adams Redevelopment - Phase 6 A
ADDRESS: 100 Raddison Court
Syracuse, NY 13202
CLIENT: Langan

N

Historical Topo Map

1973, 1977

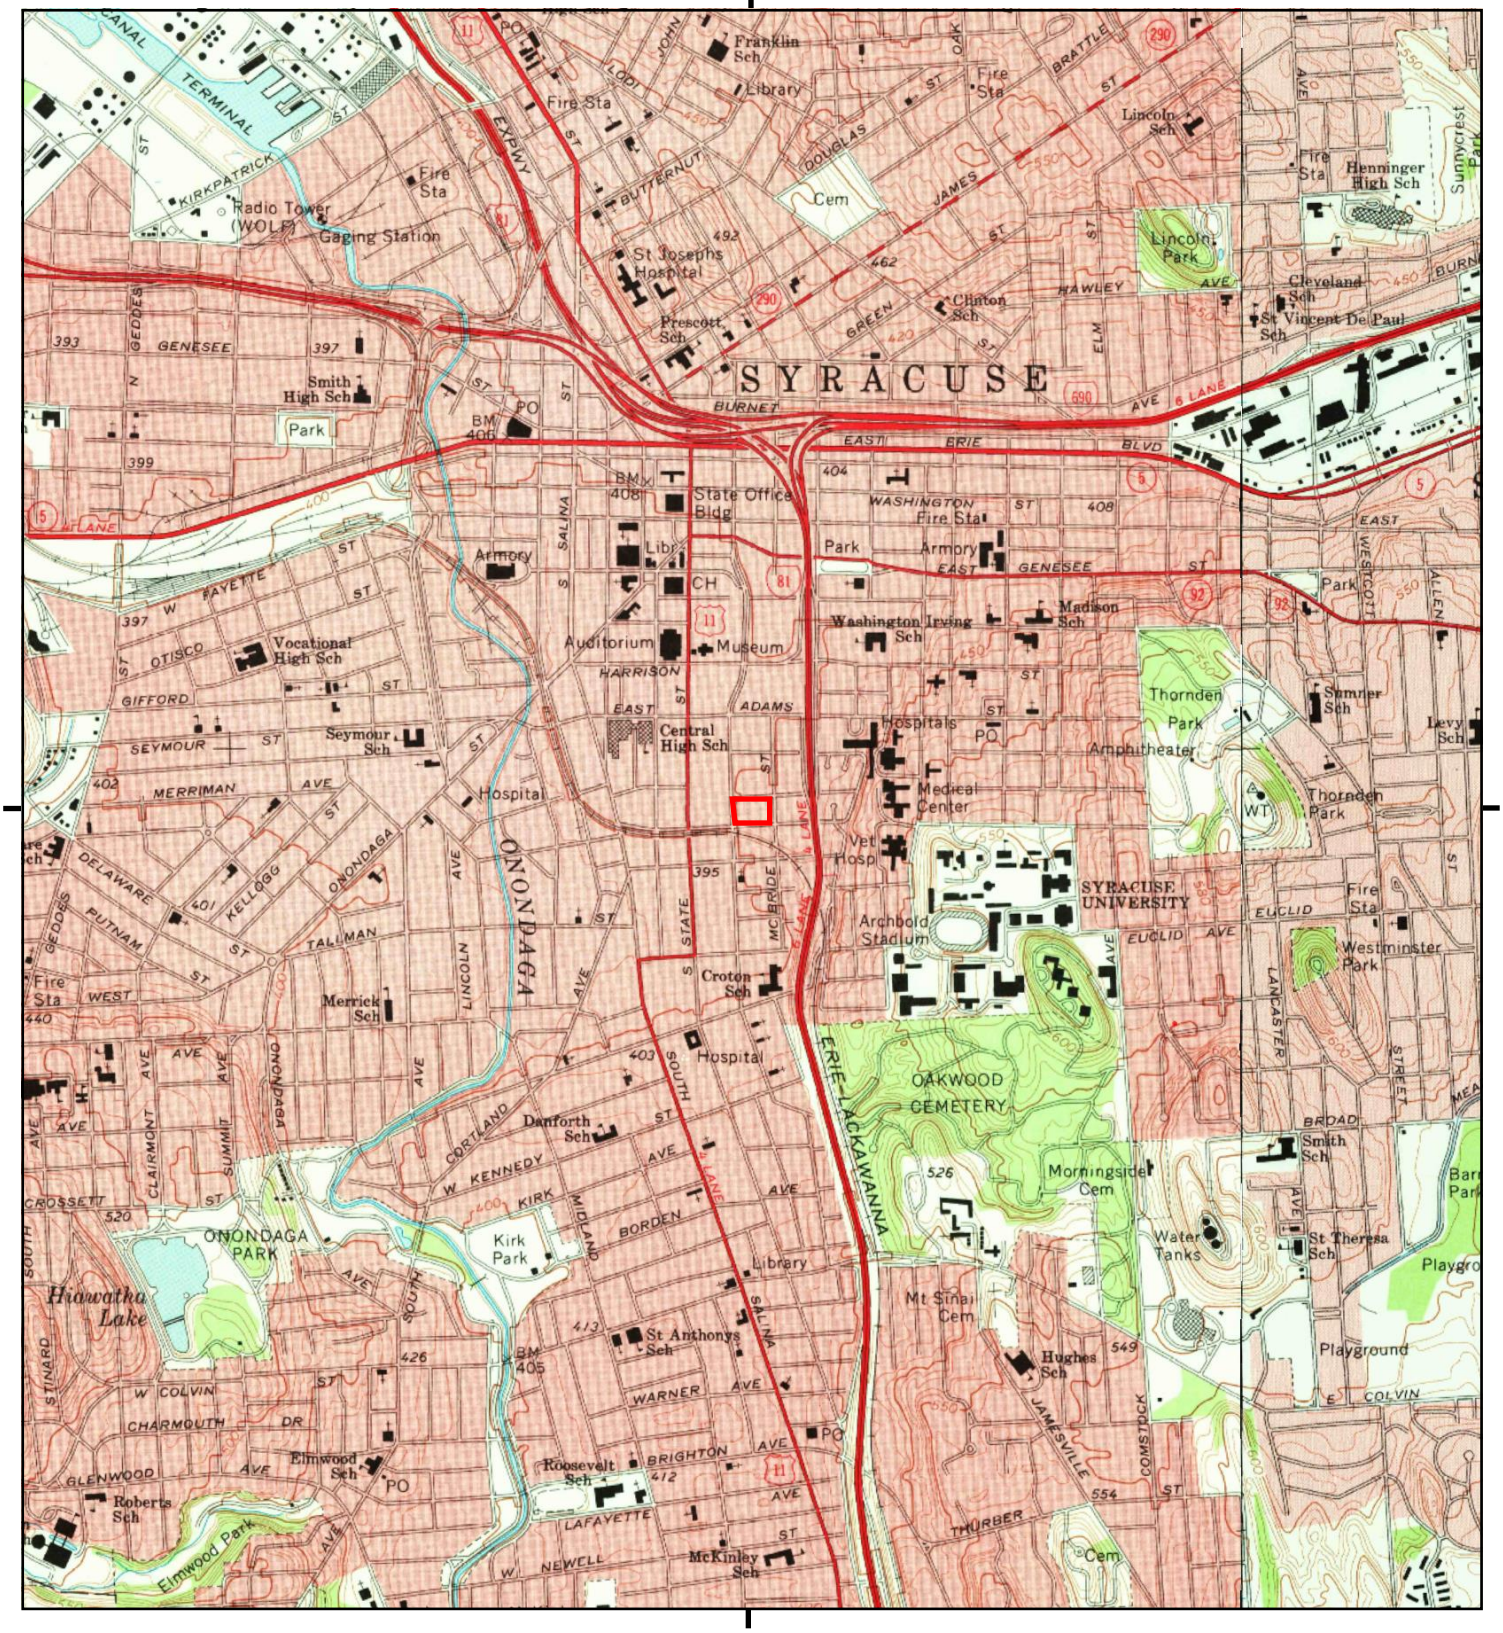

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

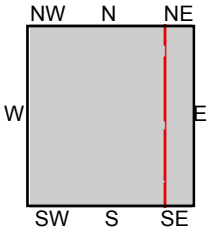

TP, Syracuse West, 1973, 7.5-minute
E, Syracuse East, 1977, 7.5-minute

SITE NAME: East Adams Redevelopment - Phase 6 A
ADDRESS: 100 Raddison Court
Syracuse, NY 13202
CLIENT: Langan

N

Historical Topo Map

1957, 1958

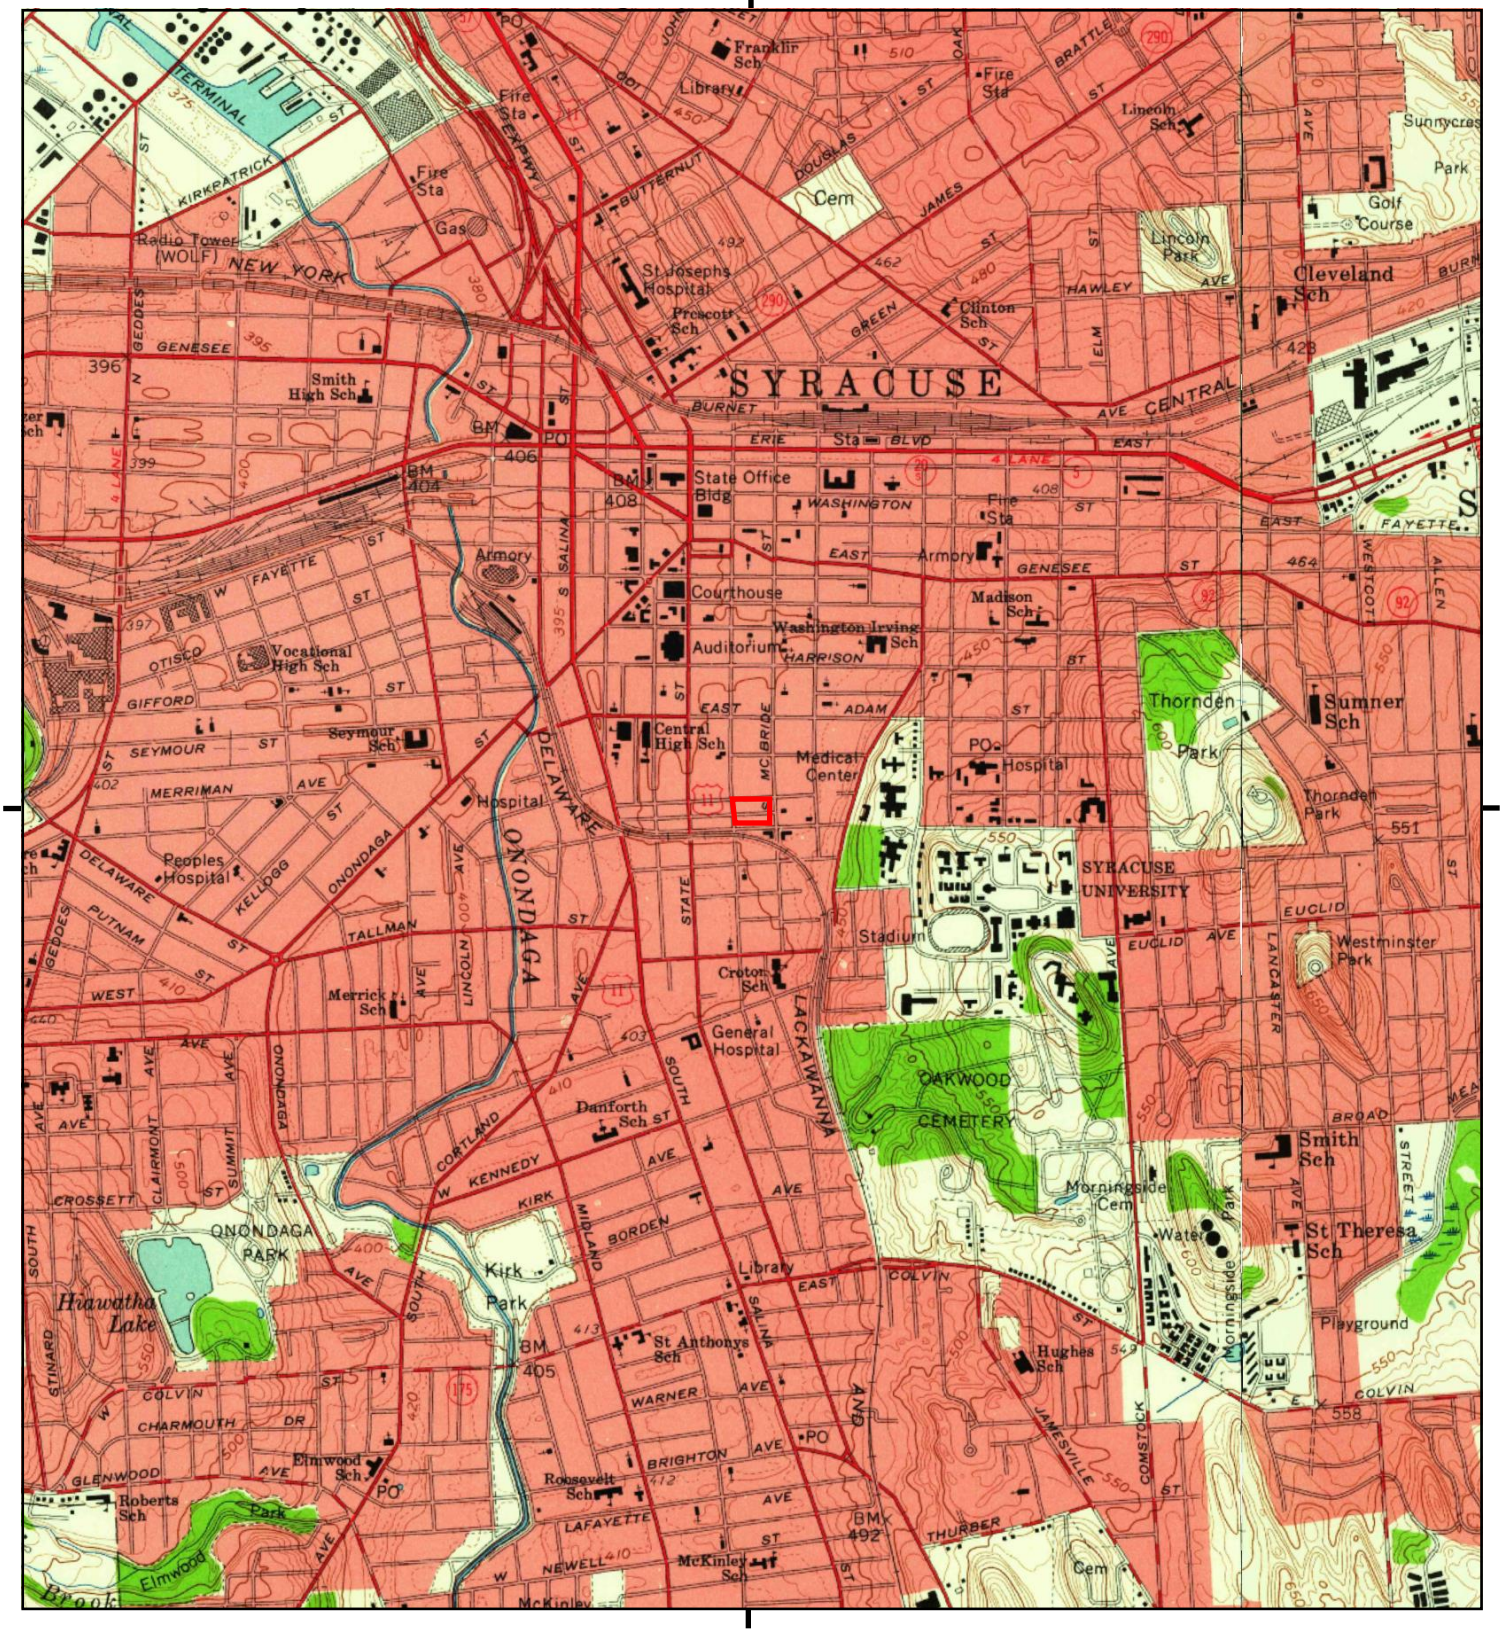

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

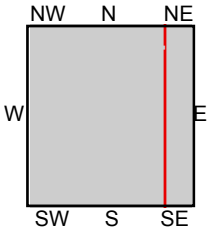

TP, Syracuse West, 1958, 7.5-minute
E, Syracuse East, 1957, 7.5-minute

SITE NAME: East Adams Redevelopment - Phase 6 A
ADDRESS: 100 Raddison Court
Syracuse, NY 13202
CLIENT: Langan

N

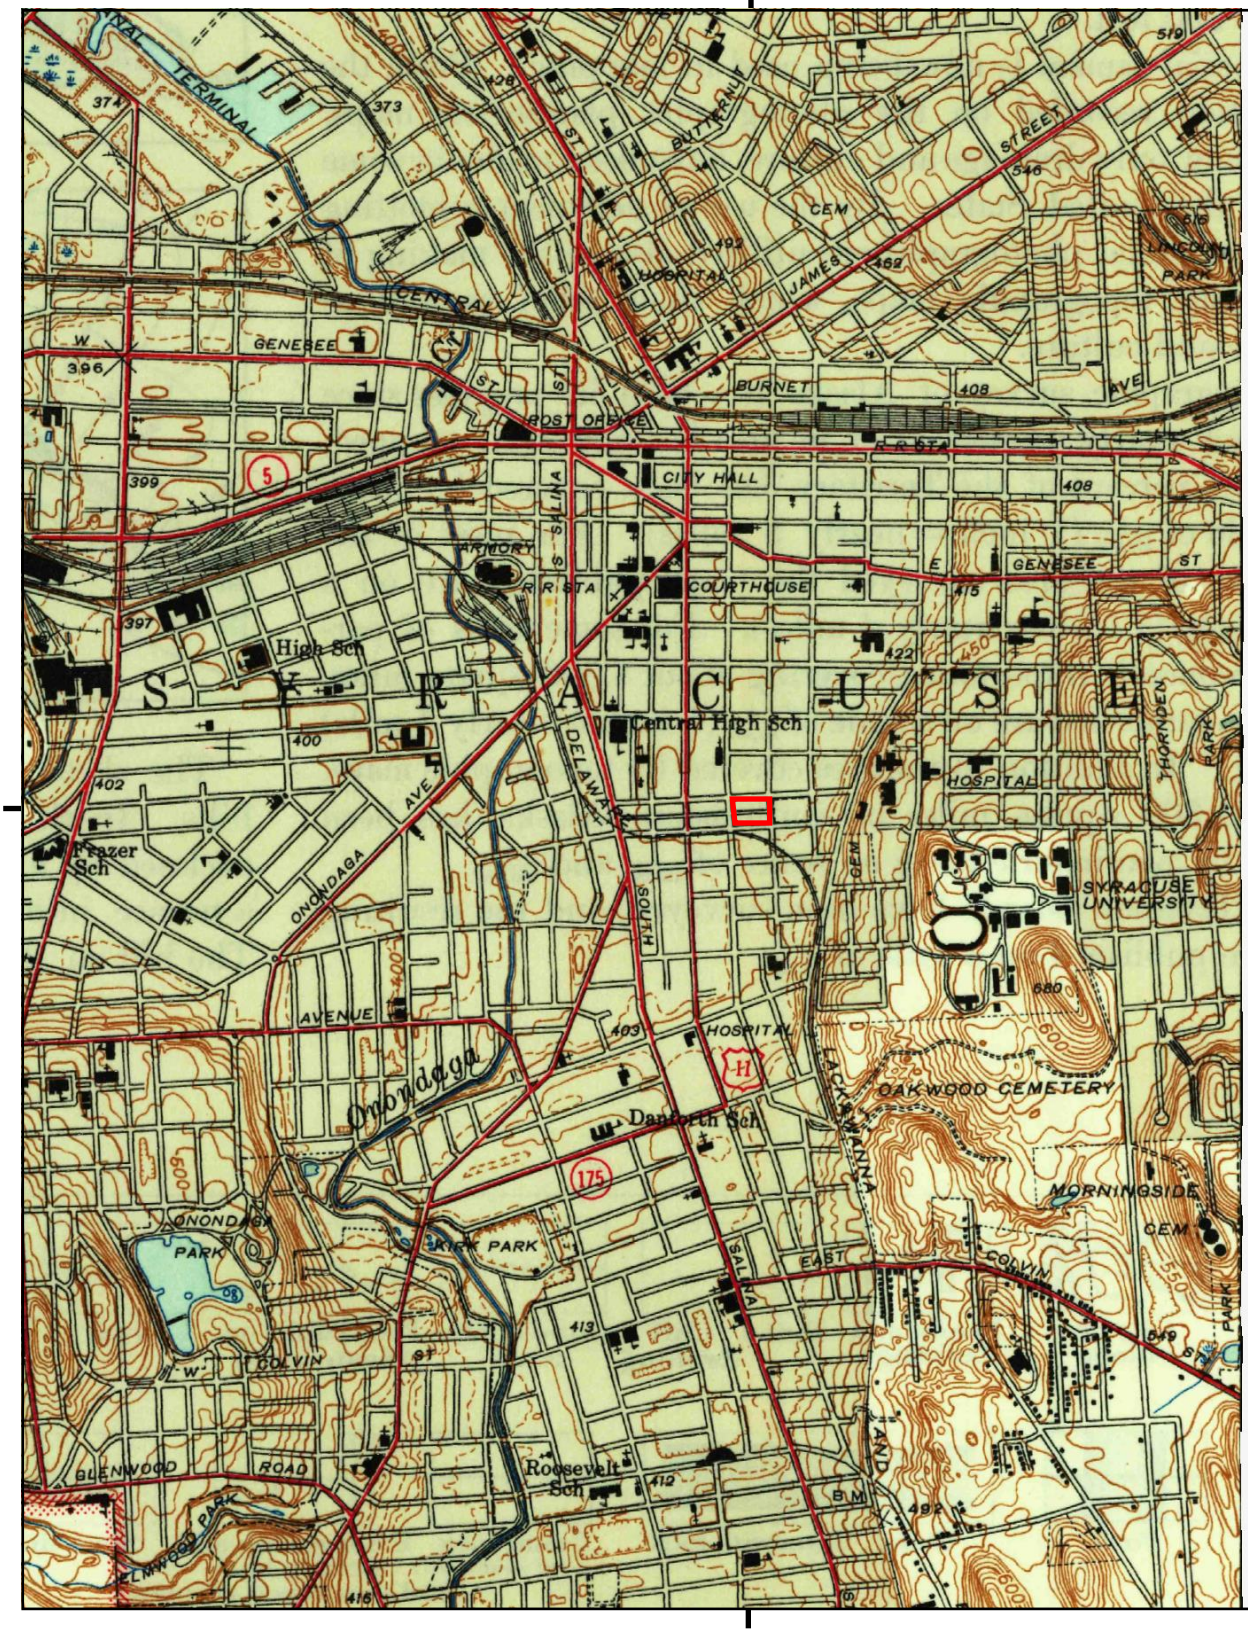

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

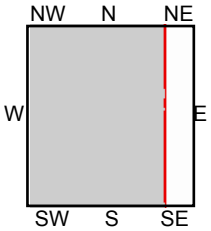

TP, Syracuse West, 1947, 7.5-minute

SITE NAME: East Adams Redevelopment - Phase 6 A
ADDRESS: 100 Raddison Court
Syracuse, NY 13202
CLIENT: Langan

N

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Syracuse West, 1939, 7.5-minute
E, Syracuse East, 1943, 7.5-minute

SITE NAME: East Adams Redevelopment - Phase 6 A
ADDRESS: 100 Raddison Court
Syracuse, NY 13202
CLIENT: Langan

N

Historical Topo Map

1938, 1939

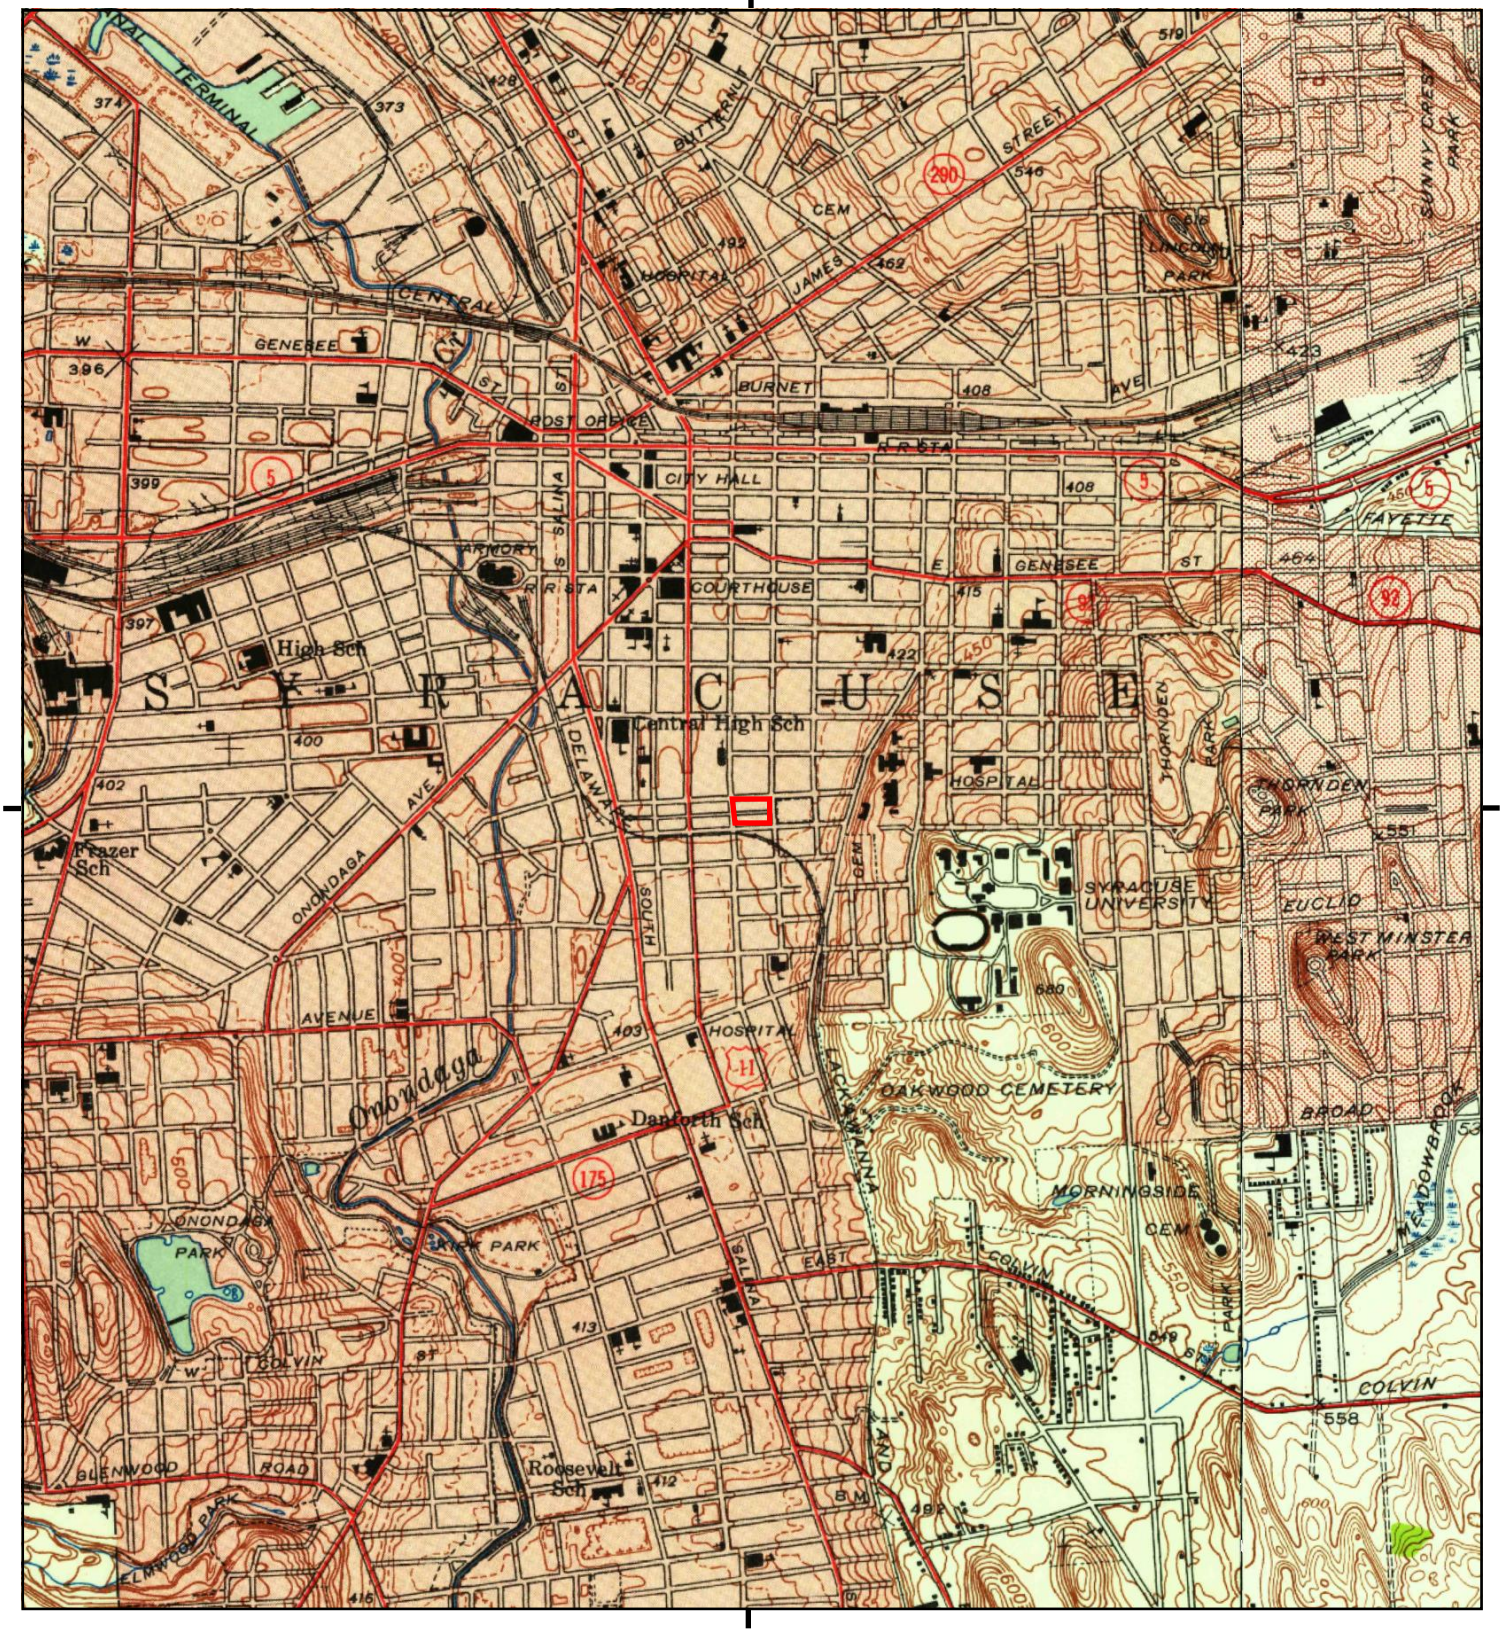

This report includes information from the following map sheet(s).

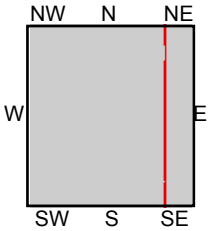

TP, Syracuse West, 1939, 7.5-minute
E, Syracuse East, 1938, 7.5-minute

SITE NAME: East Adams Redevelopment - Phase 6 A
ADDRESS: 100 Raddison Court
Syracuse, NY 13202
CLIENT: Langan

N

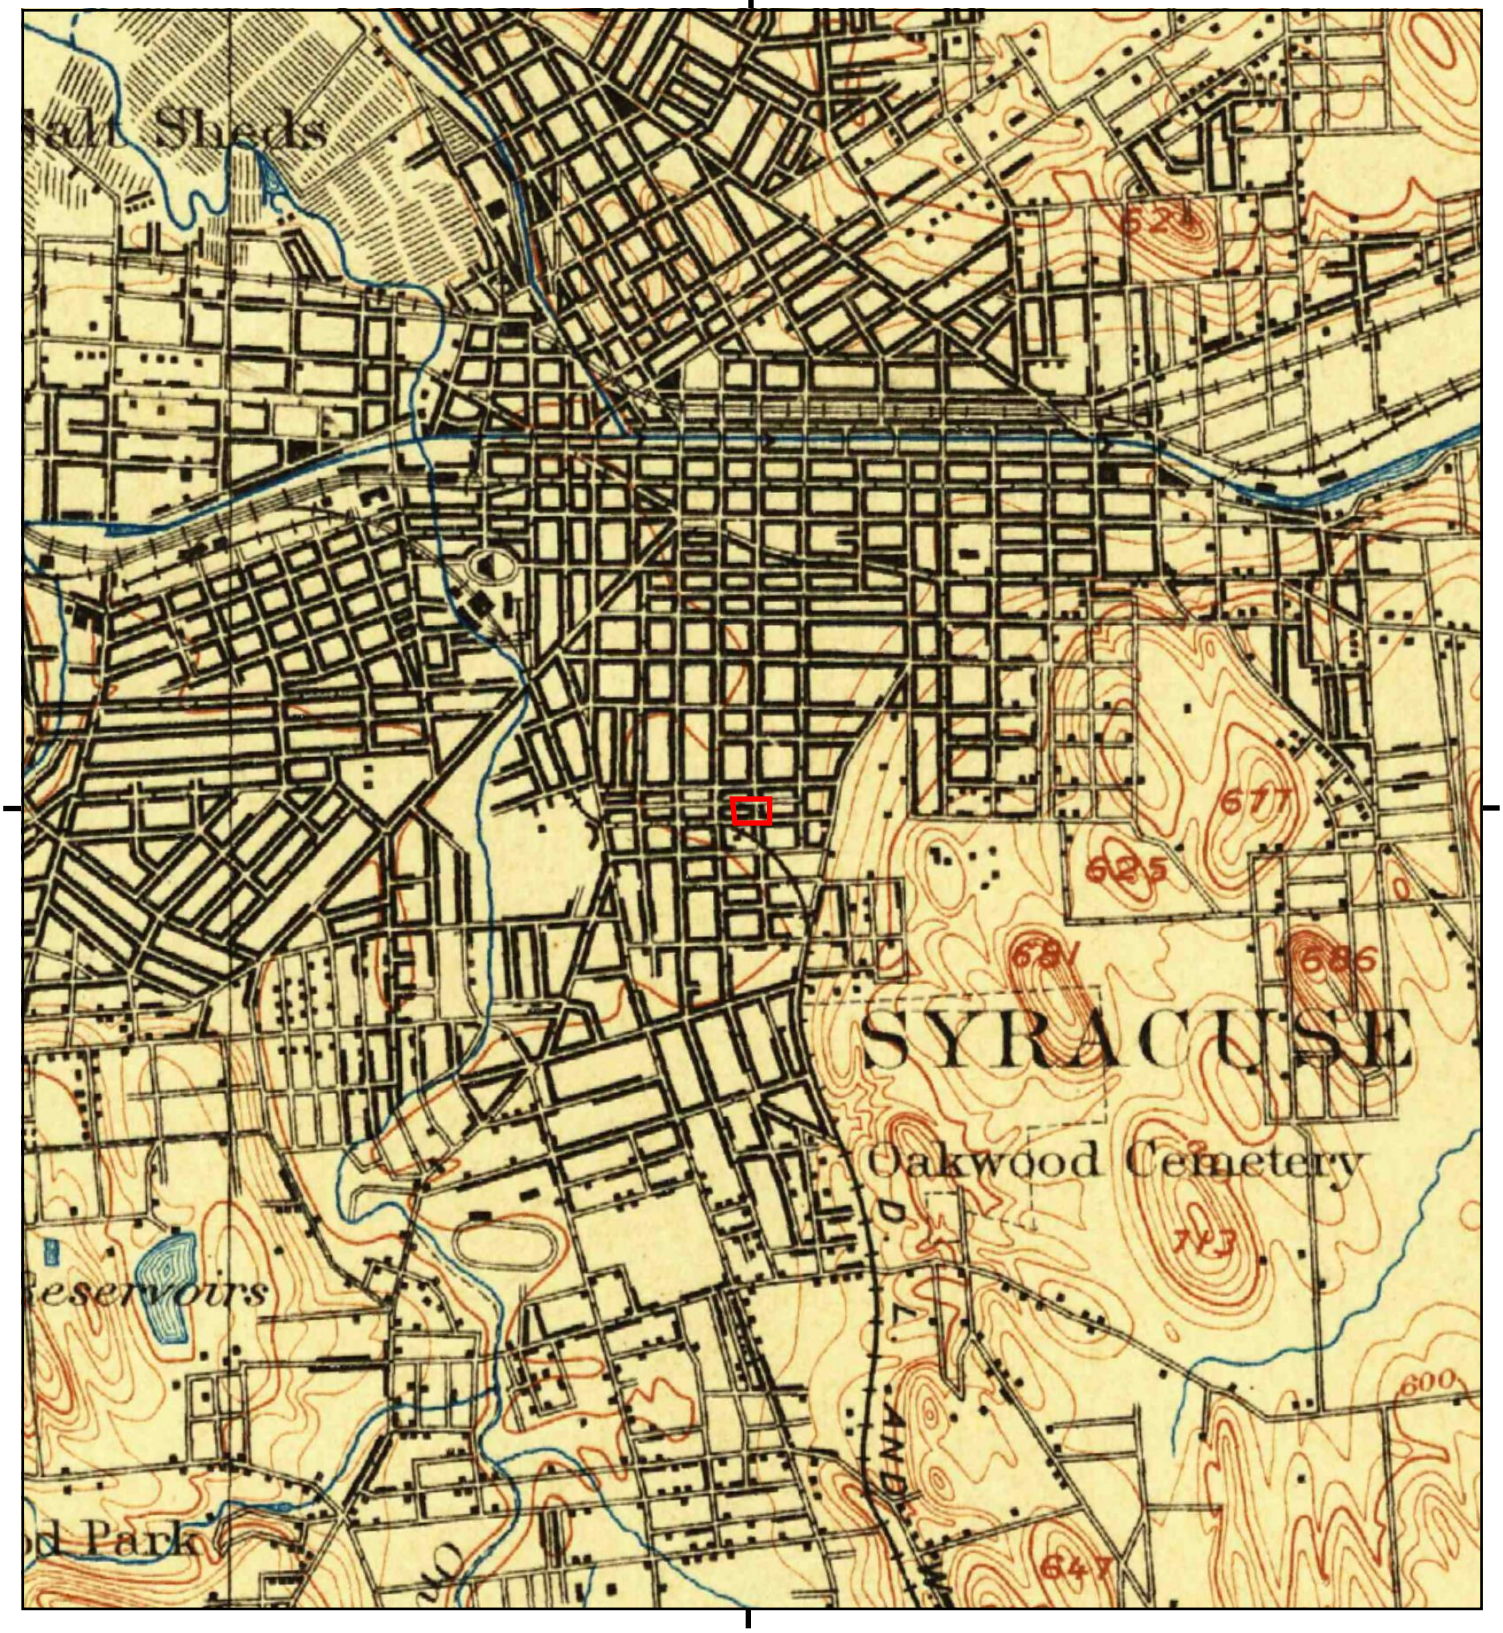

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Syracuse, 1898, 15-minute

SITE NAME: East Adams Redevelopment - Phase 6 A
ADDRESS: 100 Raddison Court
Syracuse, NY 13202
CLIENT: Langan

N

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Syracuse, 1895, 15-minute

SITE NAME: East Adams Redevelopment - Phase 6 A
ADDRESS: 100 Raddison Court
Syracuse, NY 13202
CLIENT: Langan

N

Sanborn Fire Insurance Maps

East Adams Redevelopment - Phase 6 Area

100 Raddison Court

Syracuse, NY 13202

Inquiry Number: 8026566.3

June 23, 2025

Certified Sanborn® Map Report

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

06/23/25

Site Name:

East Adams Redevelopment - I
100 Raddison Court
Syracuse, NY 13202
EDR Inquiry # 8026566.3

Client Name:

Langan
368 Ninth Avenue, 8th Floor
New York, NY 10001-2727
Contact: Lexi Haley

The Sanborn Library has been searched by EDR and maps covering the target property location as provided by Langan were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # 467D-4780-BC2F

PO # 170859701

Project EA Redevelopment - Phase 6

Maps Provided:

1990
1971
1968
1961
1953
1951
1910
1892

Sanborn® Library search results

Certification #: 467D-4780-BC2F

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ☑ Library of Congress
- ☑ University Publications of America
- ☑ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

Langan (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT. Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2025 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

1990 Source Sheets

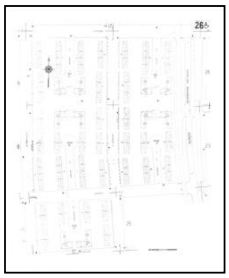
Volume 1A, Sheet 26a
1990

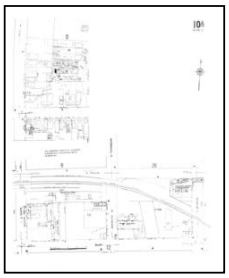
Volume 1A, Sheet 10a
1990

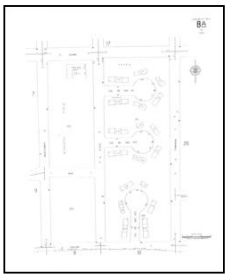
Volume 1A, Sheet 8a
1990

Volume 1A, Sheet 25a
1990

1971 Source Sheets

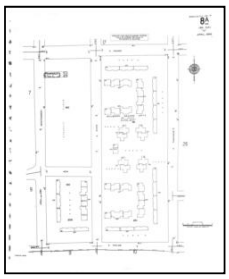
Volume 1A, Sheet 8a
1971

Volume 1A, Sheet 25a
1971

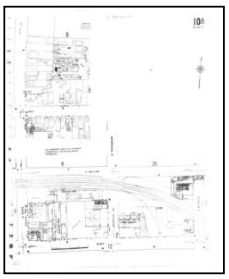
Volume 1A, Sheet 10a
1971

Volume 1A, Sheet 26a
1971

1968 Source Sheets

Volume 1A, Sheet 26a
1968

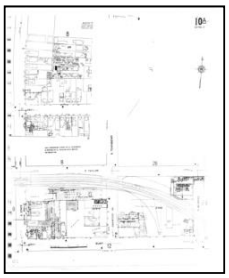
Volume 1A, Sheet 10a
1968

Volume 1A, Sheet 25a
1968

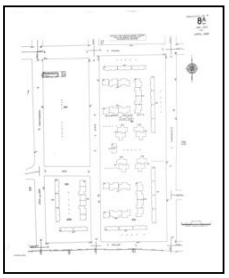
Volume 1A, Sheet 8a
1968

1961 Source Sheets

Volume 1A, Sheet 25a
1961

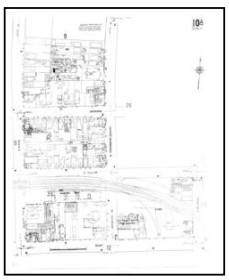
Volume 1A, Sheet 10a
1961

Volume 1A, Sheet 26a
1961

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

1953 Source Sheets

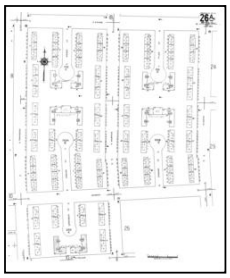

Volume 1A, Sheet 26a
1953

Volume 1A, Sheet 10a
1953

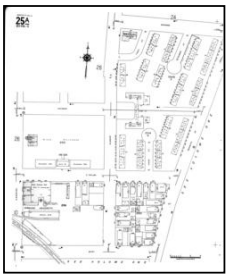

Volume 1A, Sheet 25a
1953

1951 Source Sheets

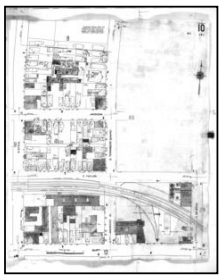

Volume 1, Sheet 10
1951

Volume 1, Sheet 25
1951

Volume 1, Sheet 89
1951

1910 Source Sheets

Volume 1, Sheet 10
1910

Volume 1, Sheet 25
1910

1892 Source Sheets

Volume 1, Sheet 58
1892

Volume 1, Sheet 49
1892

Volume 1, Sheet 57
1892

Volume 1, Sheet 50
1892

Certified Sanborn® Map

1990

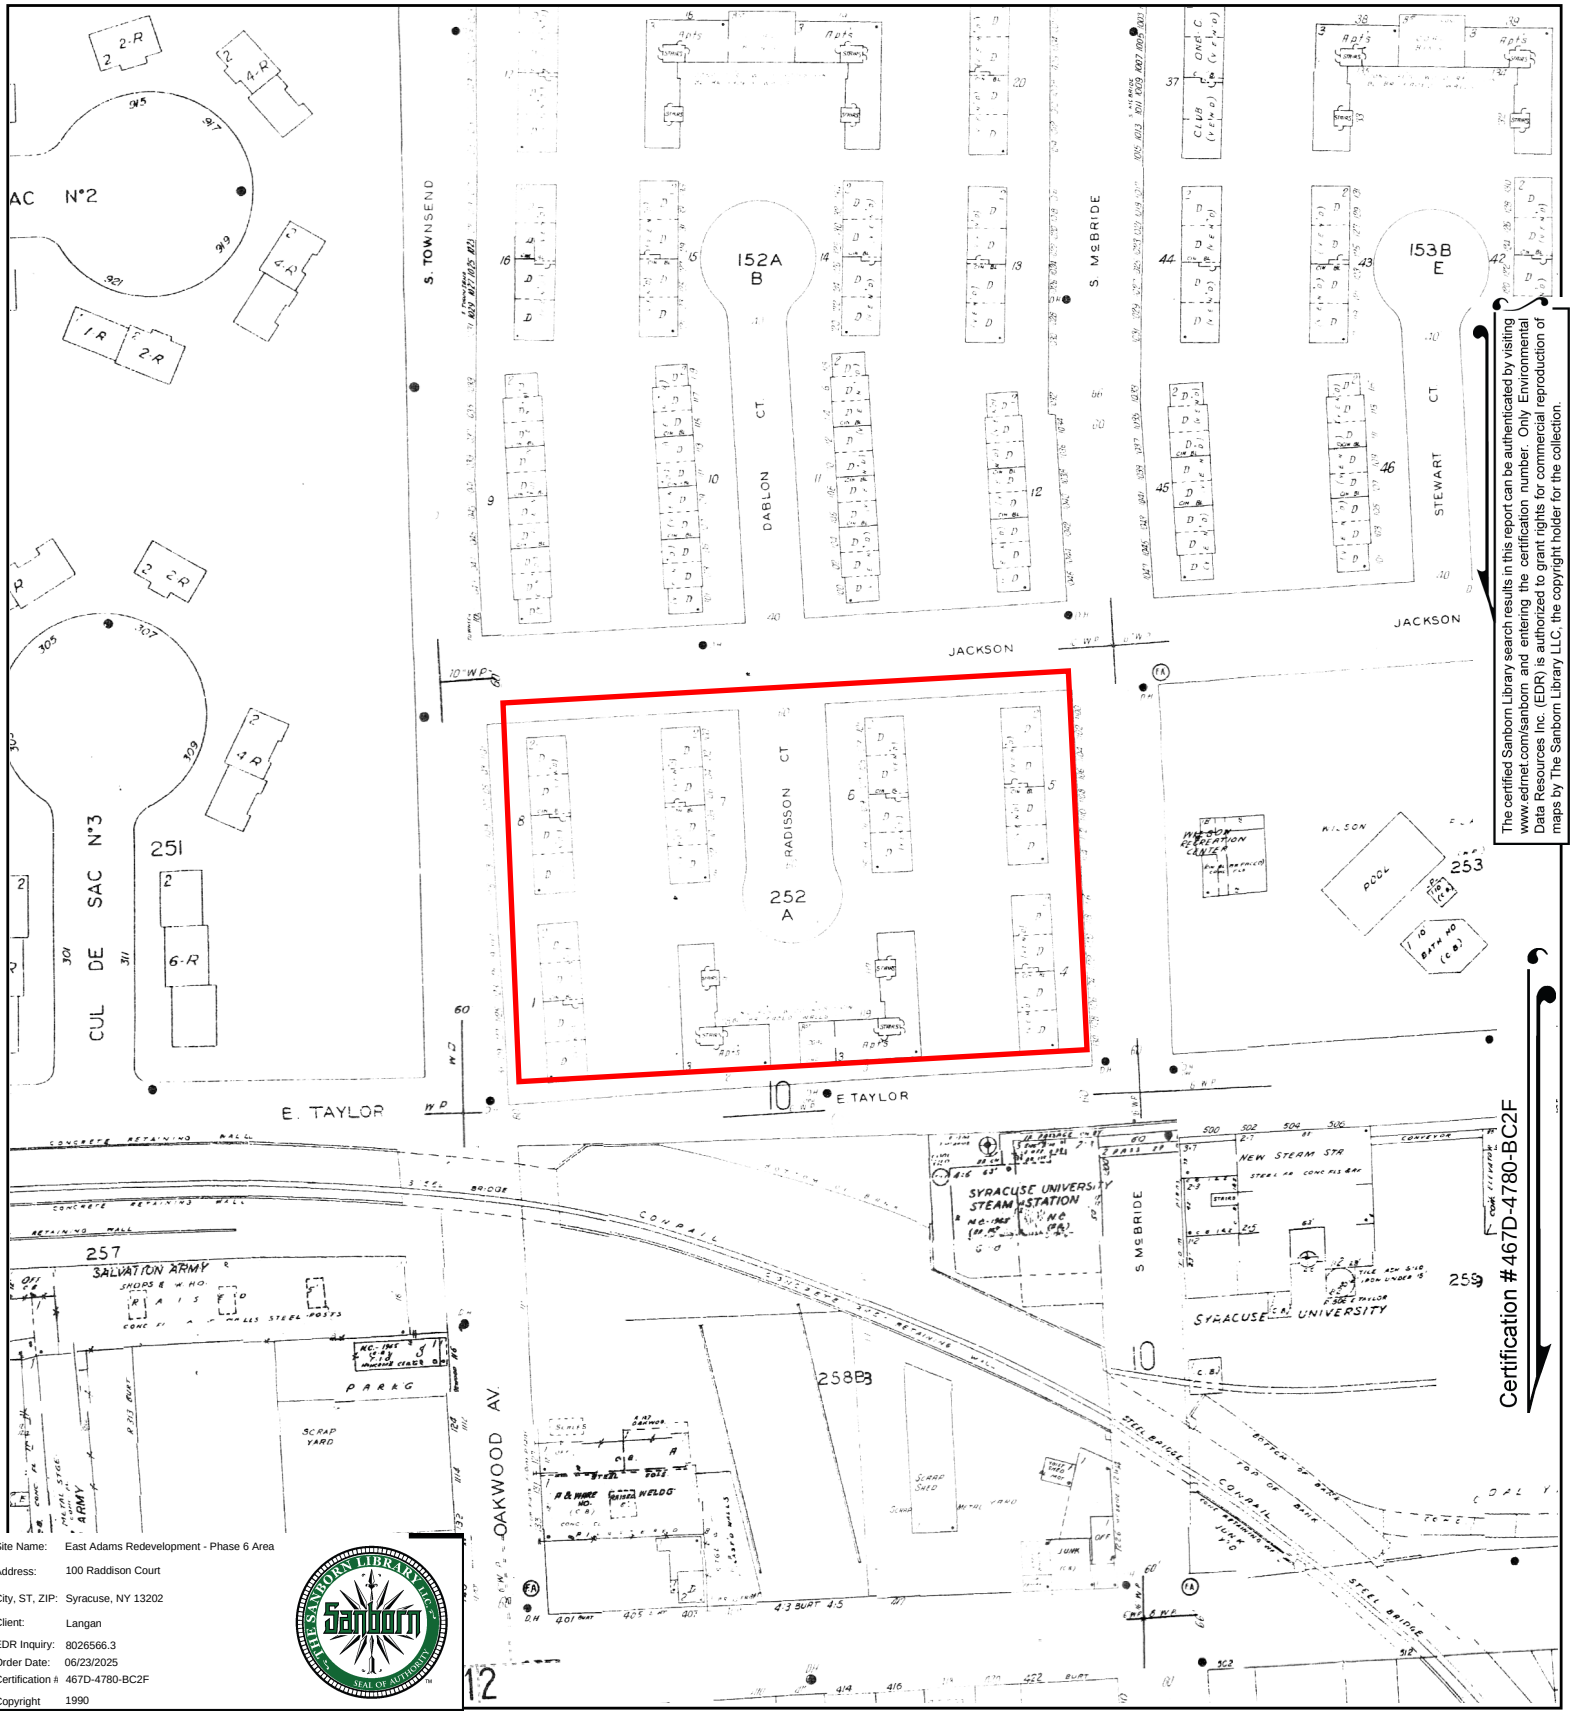

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	East Adams Redevelopment - Phase 6 Area
Address:	100 Raddison Court
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan
EDR Inquiry:	8026566.3
Order Date:	06/23/2025
Certification #:	467D-4780-BC2F
Copyright	1990

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

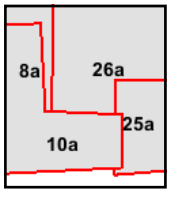

Volume 1A, Sheet 25a
Volume 1A, Sheet 8a
Volume 1A, Sheet 10a
Volume 1A, Sheet 26a

0 Feet 150 300 600

N

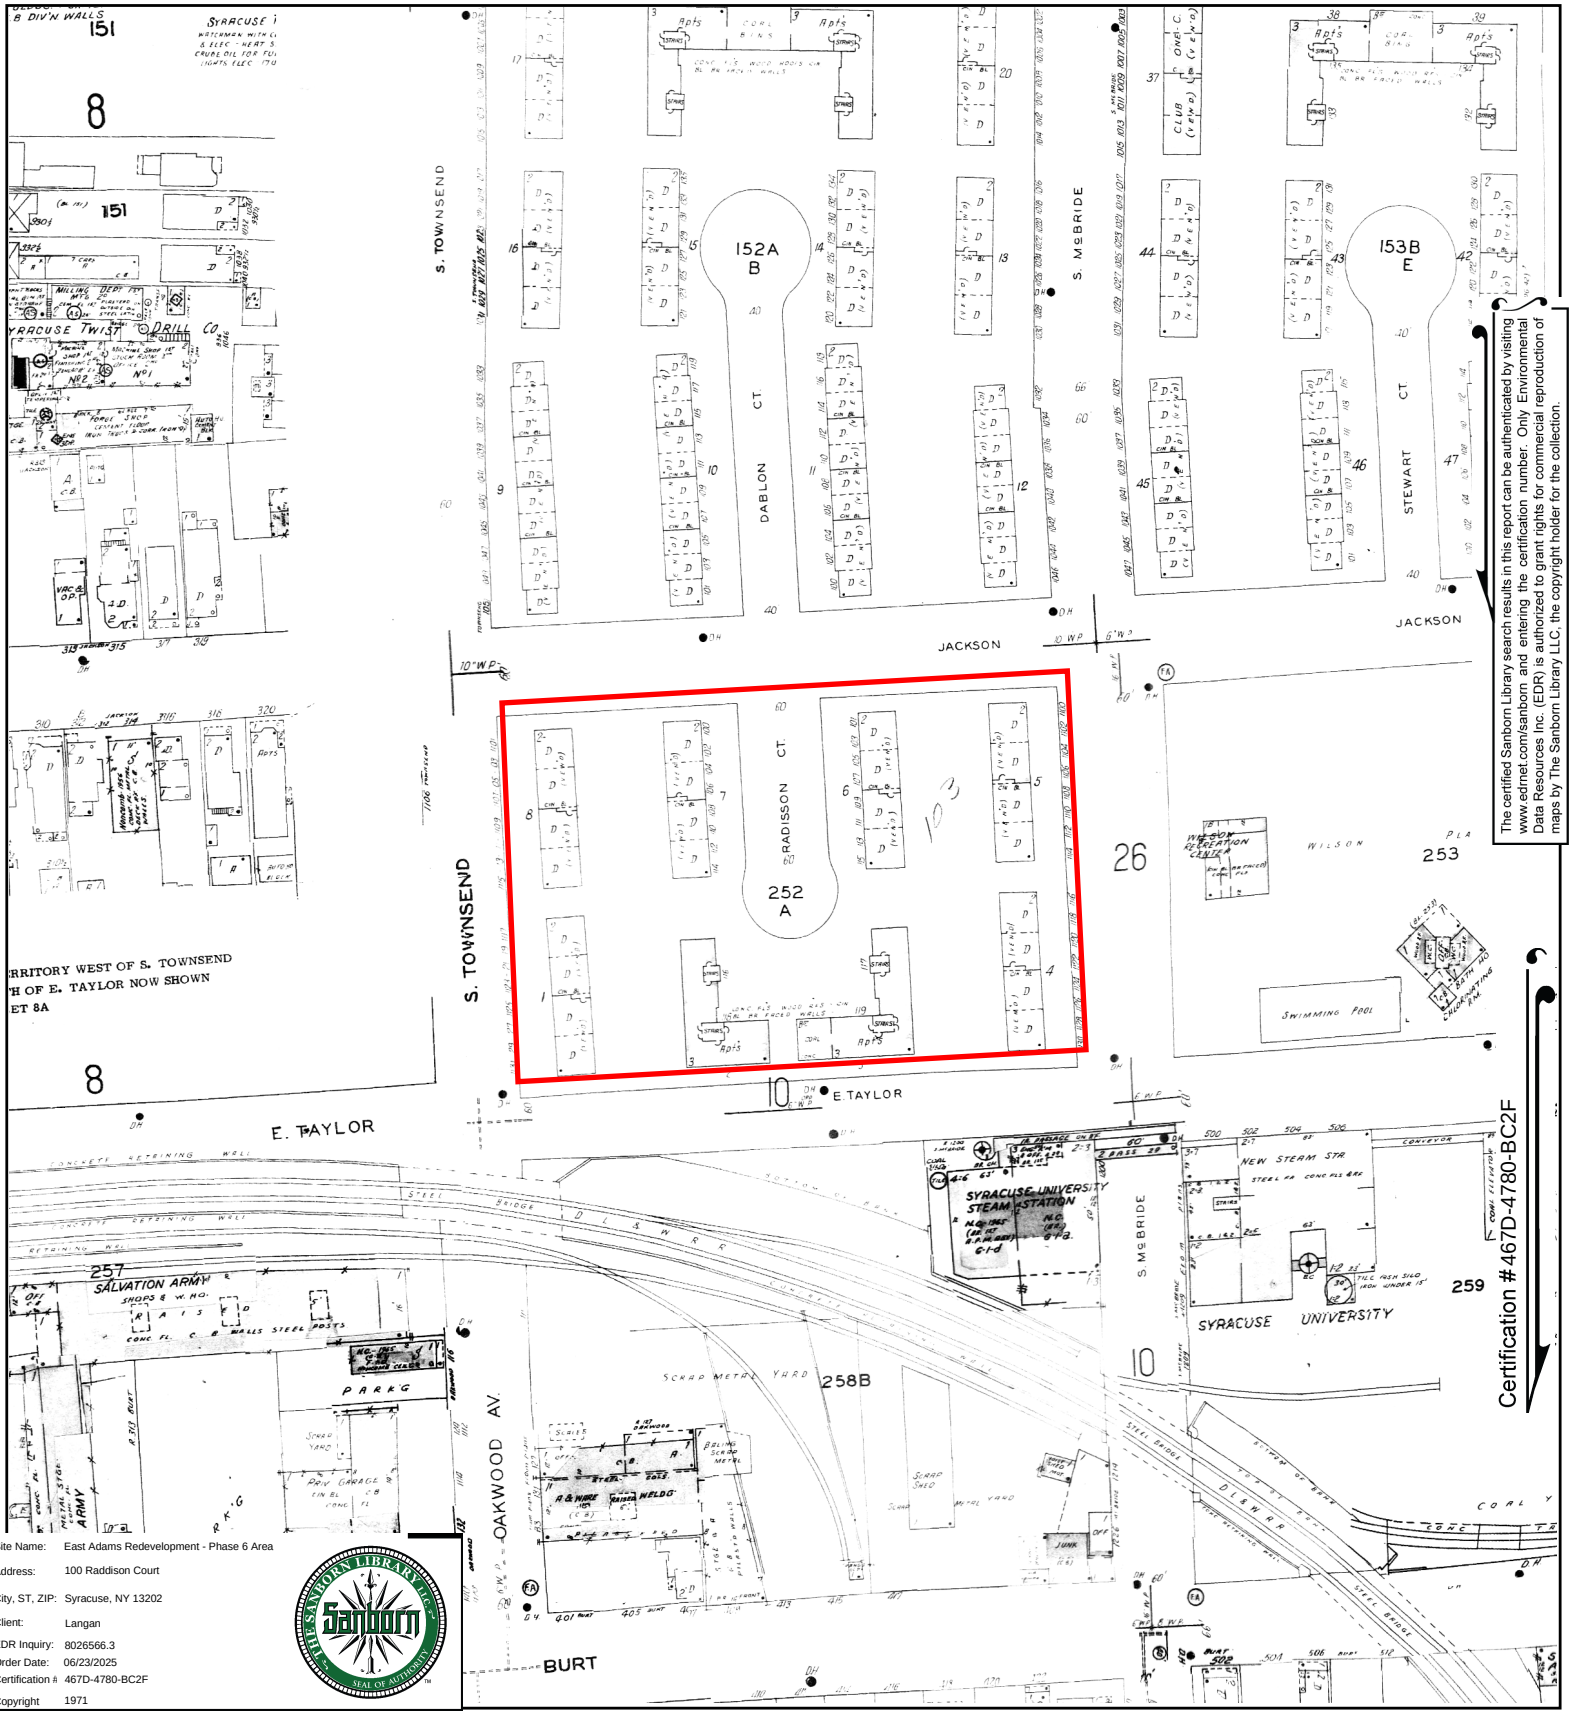

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #467D-4780-BC2F

Site Name:	East Adams Redevelopment - Phase 6 Area
Address:	100 Raddison Court
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan
EDR Inquiry:	8026566.3
Order Date:	06/23/2025
Certification #:	467D-4780-BC2F
Copyright	1971

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

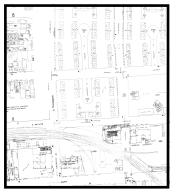

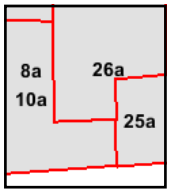

Volume 1A, Sheet 26a
Volume 1A, Sheet 10a
Volume 1A, Sheet 25a
Volume 1A, Sheet 8a

0 Feet 150 300 600

N

Certified Sanborn® Map

1968

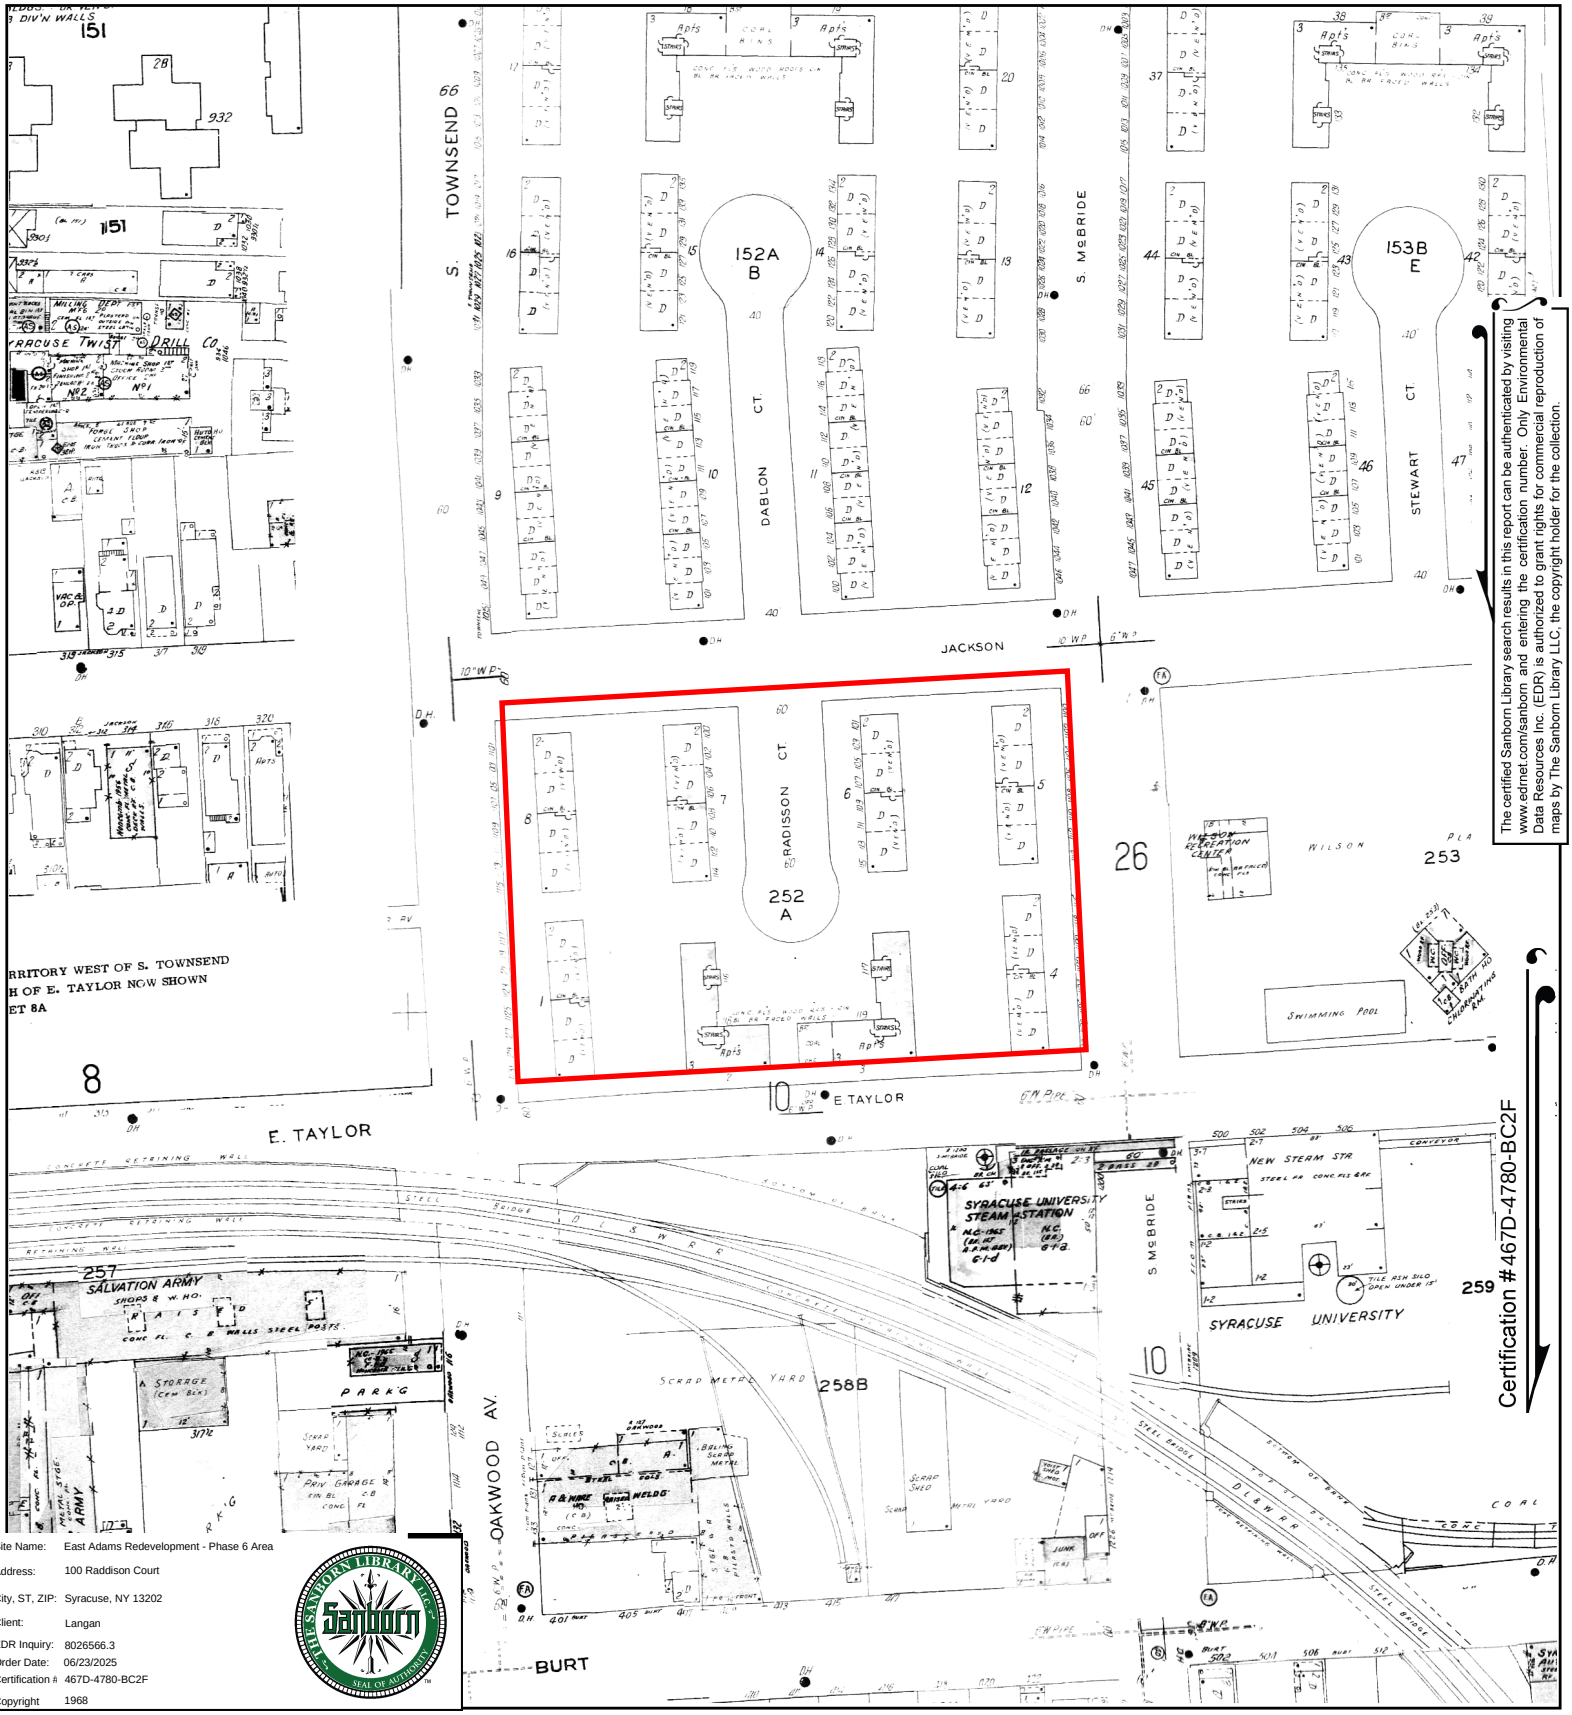

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	East Adams Redevelopment - Phase 6 Area
Address:	100 Raddison Court
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan
EDR Inquiry:	8026566.3
Order Date:	06/23/2025
Certification #	467D-4780-BC2F
Copyright	1968

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

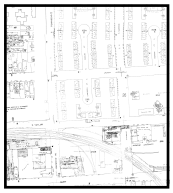

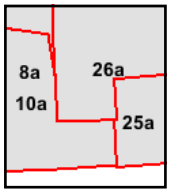

Volume 1A, Sheet 8a
Volume 1A, Sheet 25a
Volume 1A, Sheet 10a
Volume 1A, Sheet 26a

0 Feet 150 300 600

N

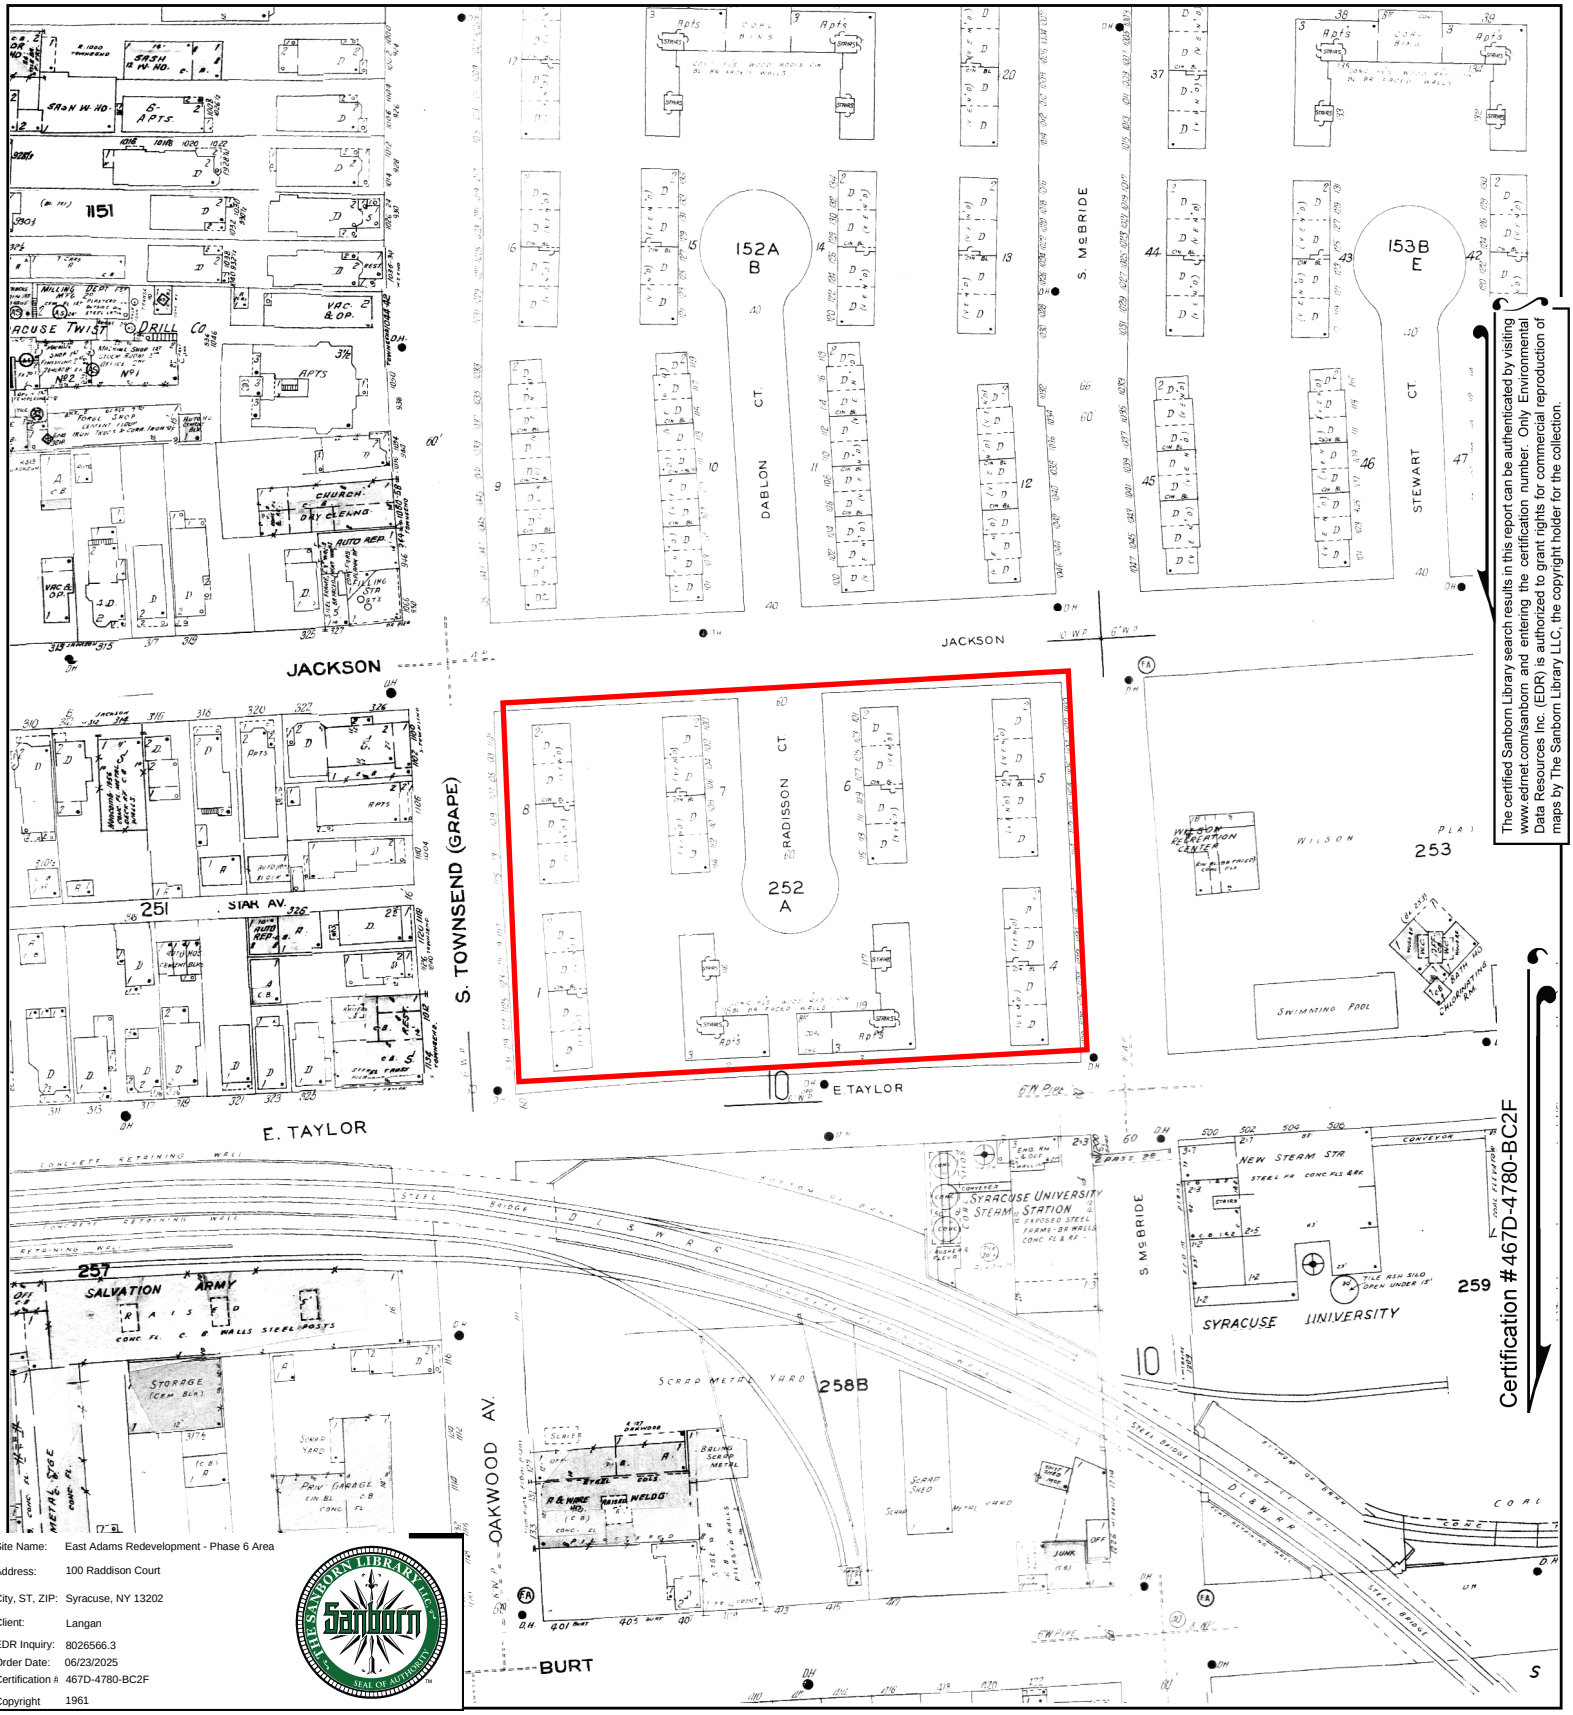

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #467D-4780-BC2F

Site Name:	East Adams Redevelopment - Phase 6 Area
Address:	100 Raddison Court
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan
EDR Inquiry:	8026566.3
Order Date:	06/23/2025
Certification #:	467D-4780-BC2F
Copyright	1961

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

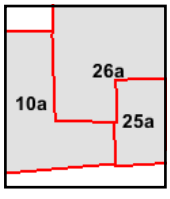

Volume 1A, Sheet 26a
Volume 1A, Sheet 10a
Volume 1A, Sheet 25a

0 Feet 150 300 600

N

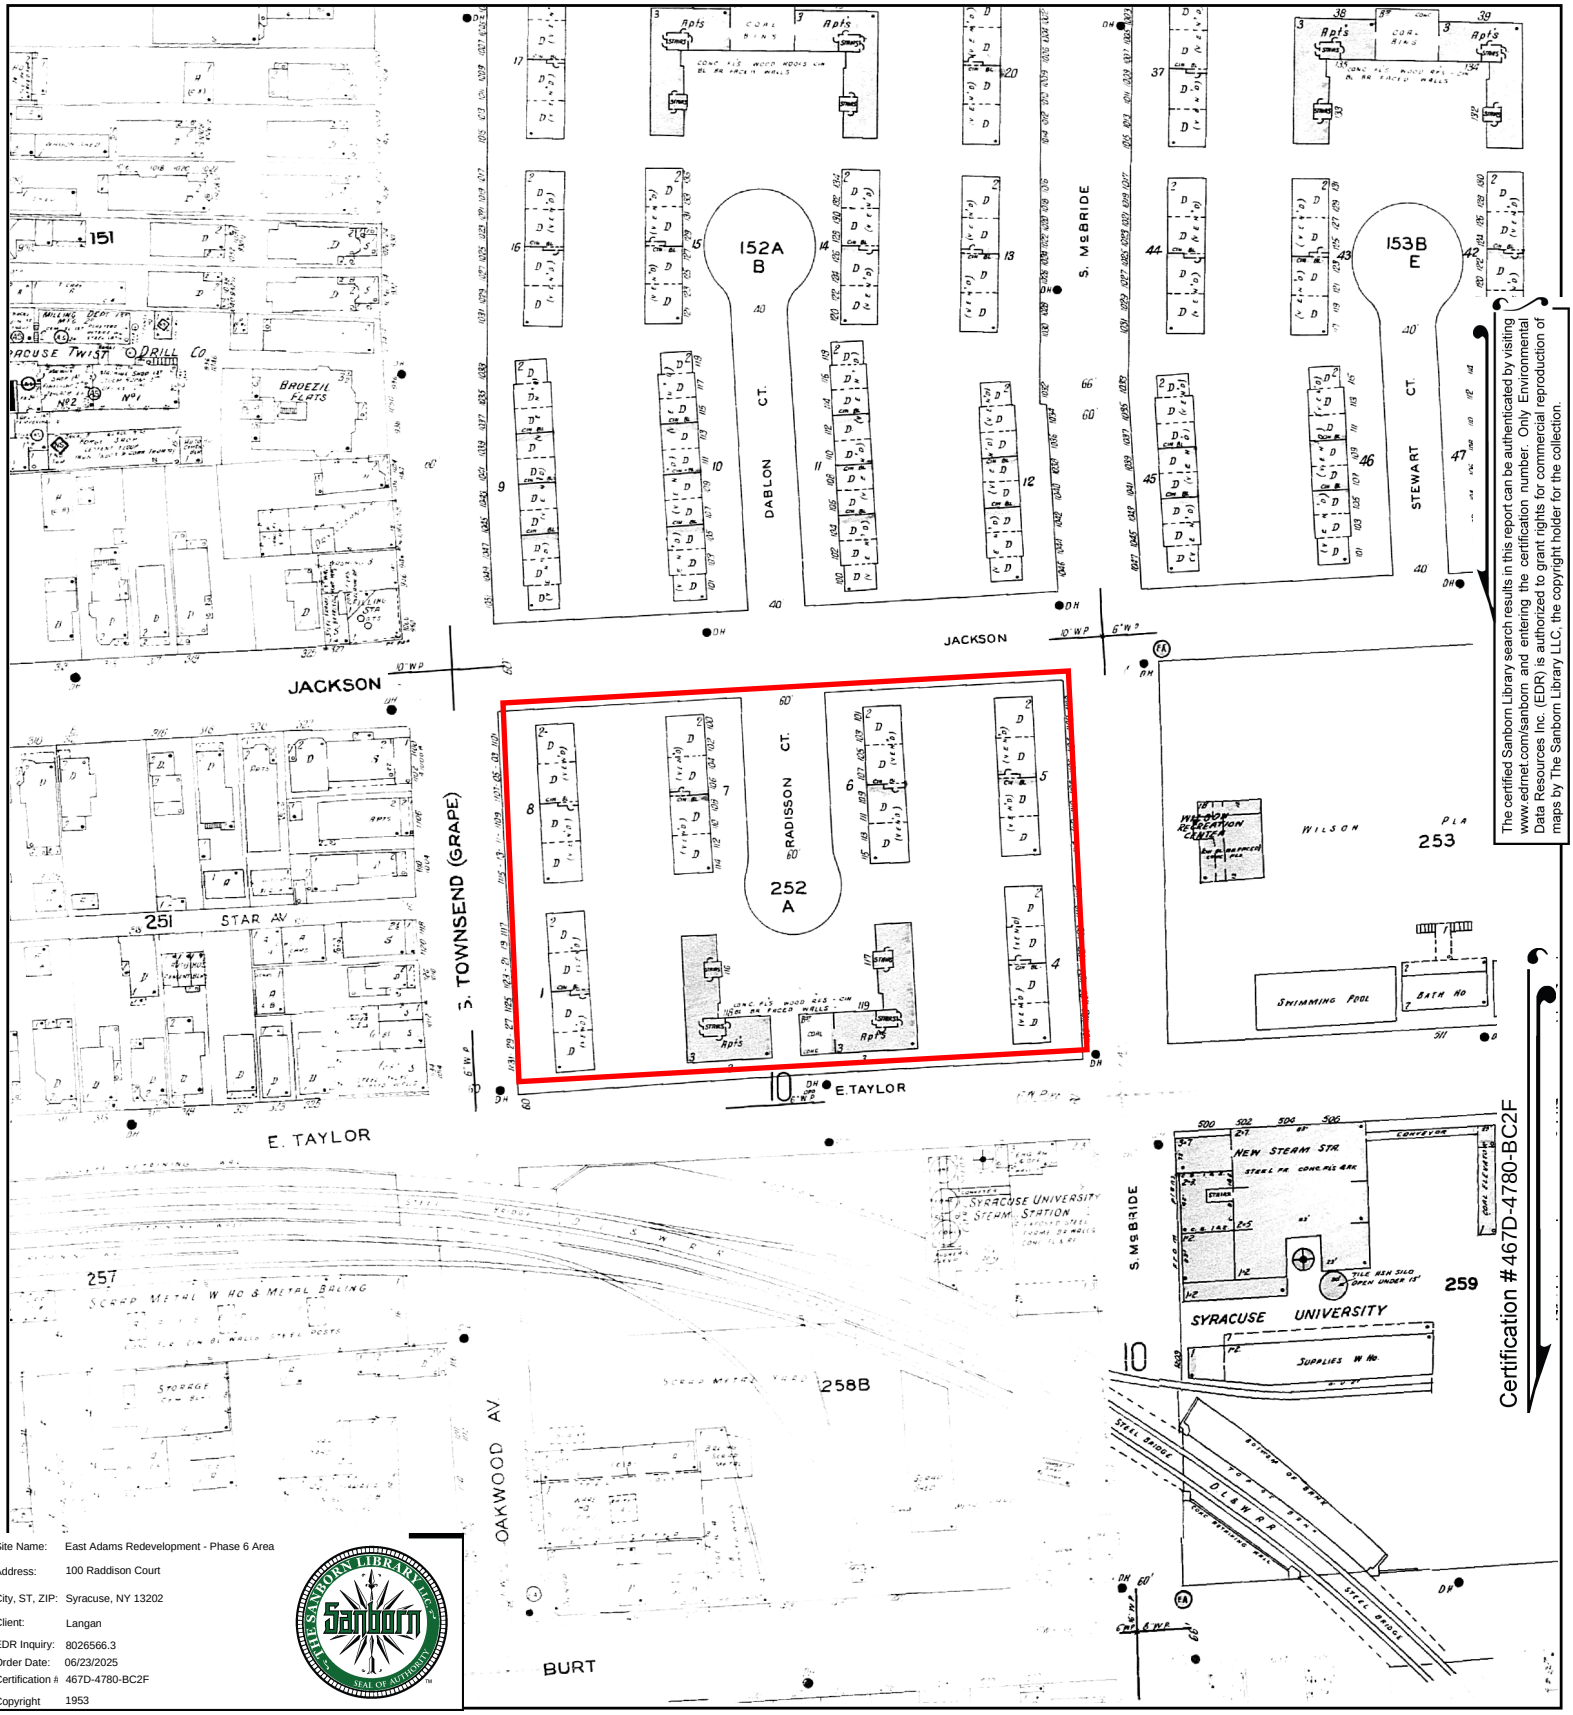

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #467D-4780-BC2F

Site Name:	East Adams Redevelopment - Phase 6 Area
Address:	100 Raddison Court
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan
EDR Inquiry:	8026566.3
Order Date:	06/23/2025
Certification #:	467D-4780-BC2F
Copyright	1953

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

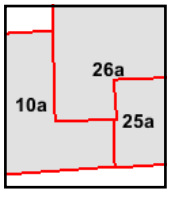

Volume 1A, Sheet 25a
Volume 1A, Sheet 10a
Volume 1A, Sheet 26a

0 Feet 150 300 600

N

Certified Sanborn® Map

1951

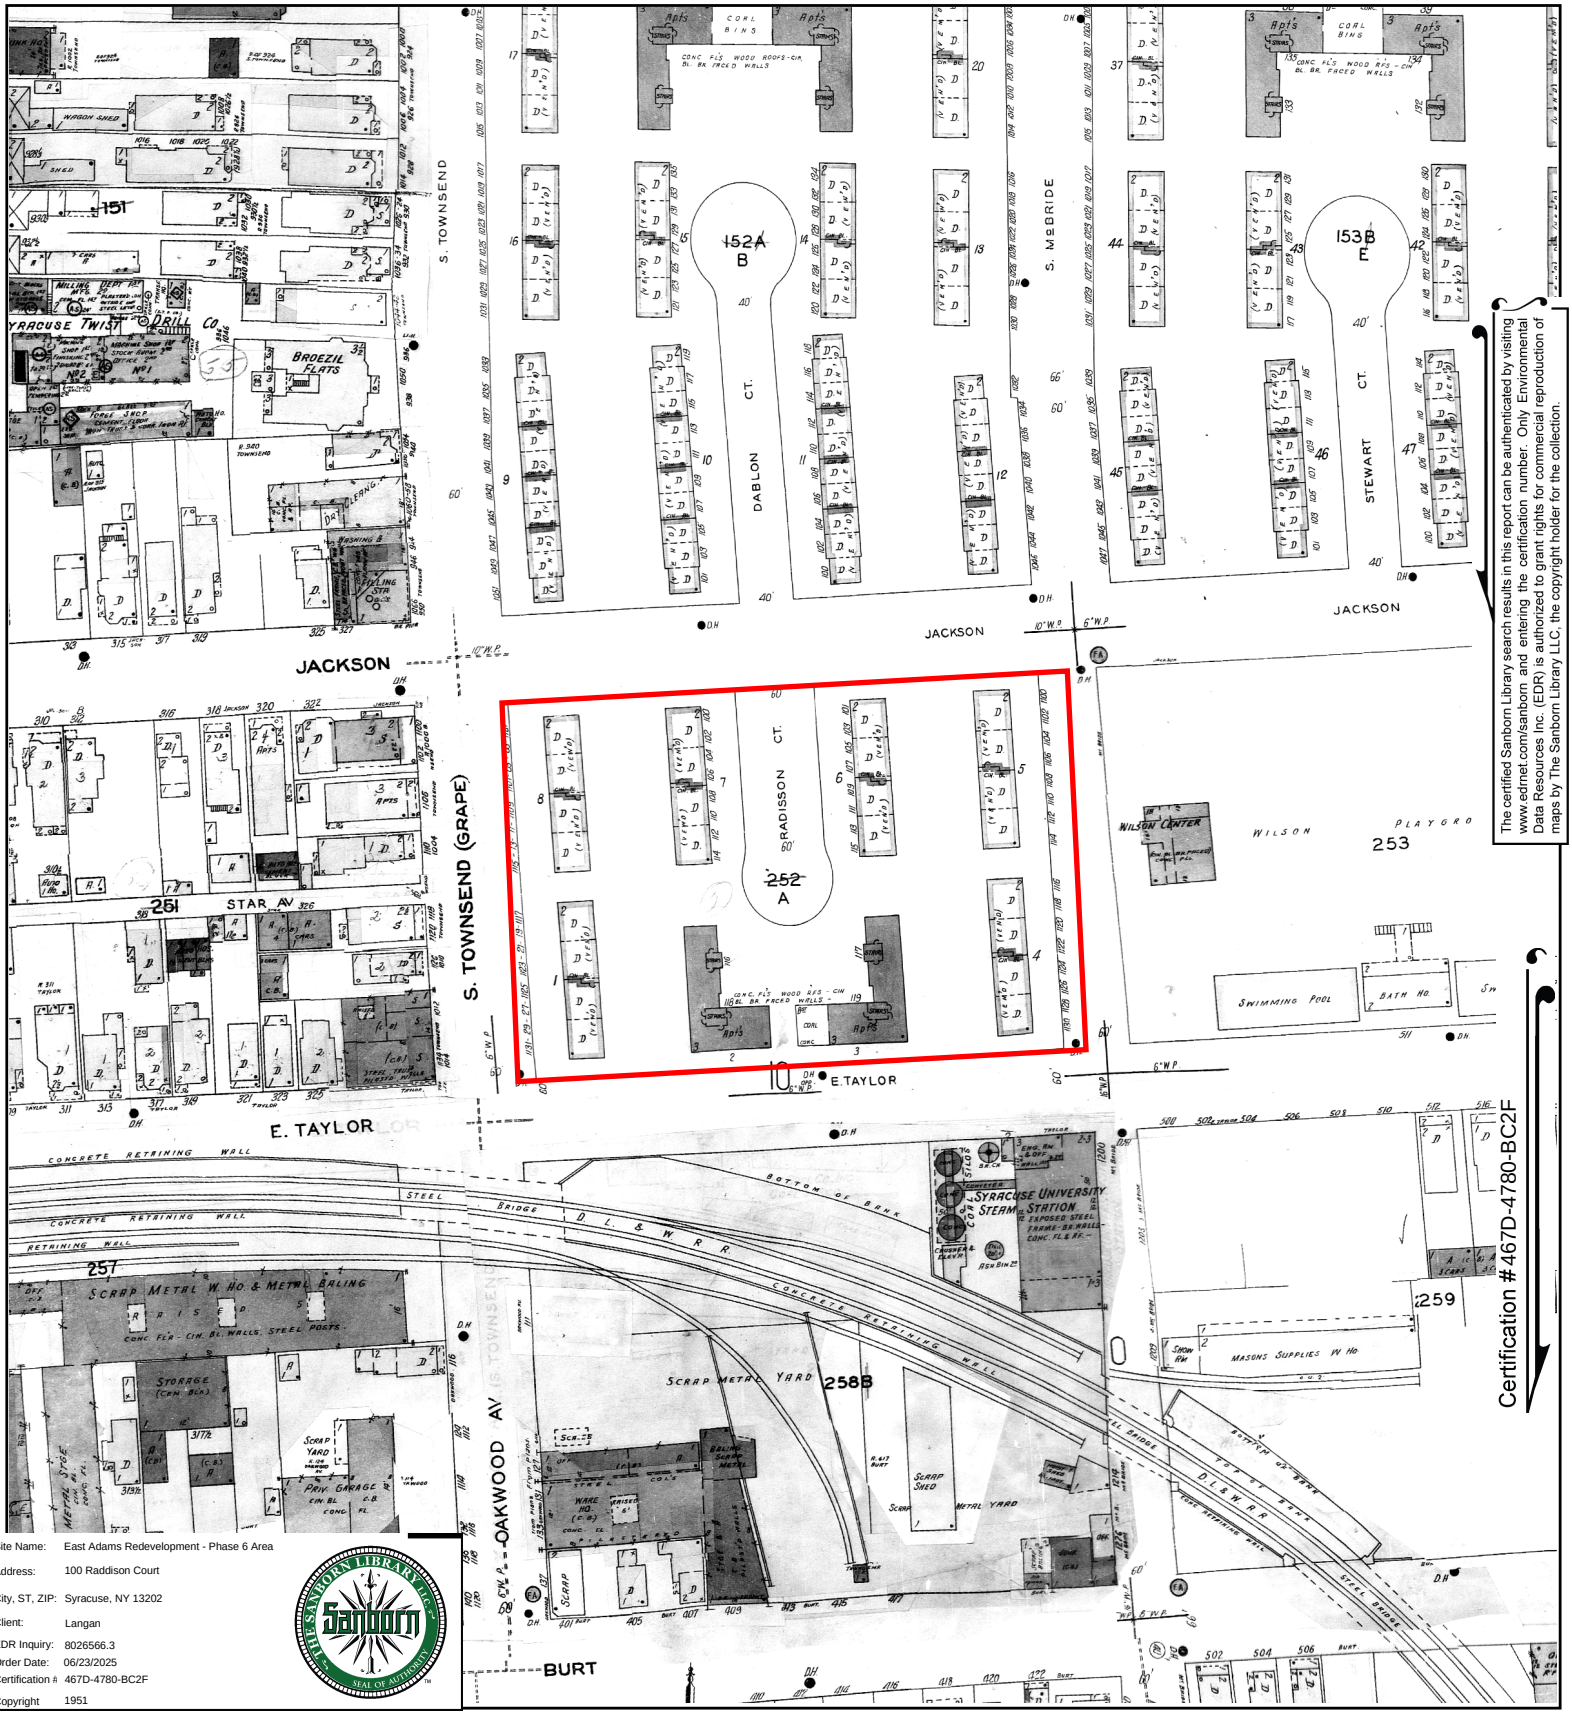

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #467D-4780-BC2F

Site Name:	East Adams Redevelopment - Phase 6 Area
Address:	100 Raddison Court
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan
EDR Inquiry:	8026566.3
Order Date:	06/23/2025
Certification #:	467D-4780-BC2F
Copyright	1951

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

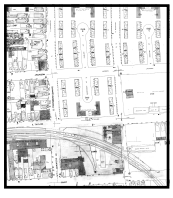

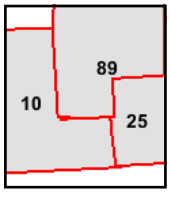

Volume 1, Sheet 89
Volume 1, Sheet 25
Volume 1, Sheet 10

0 Feet 150 300 600

N

Certified Sanborn® Map

1910

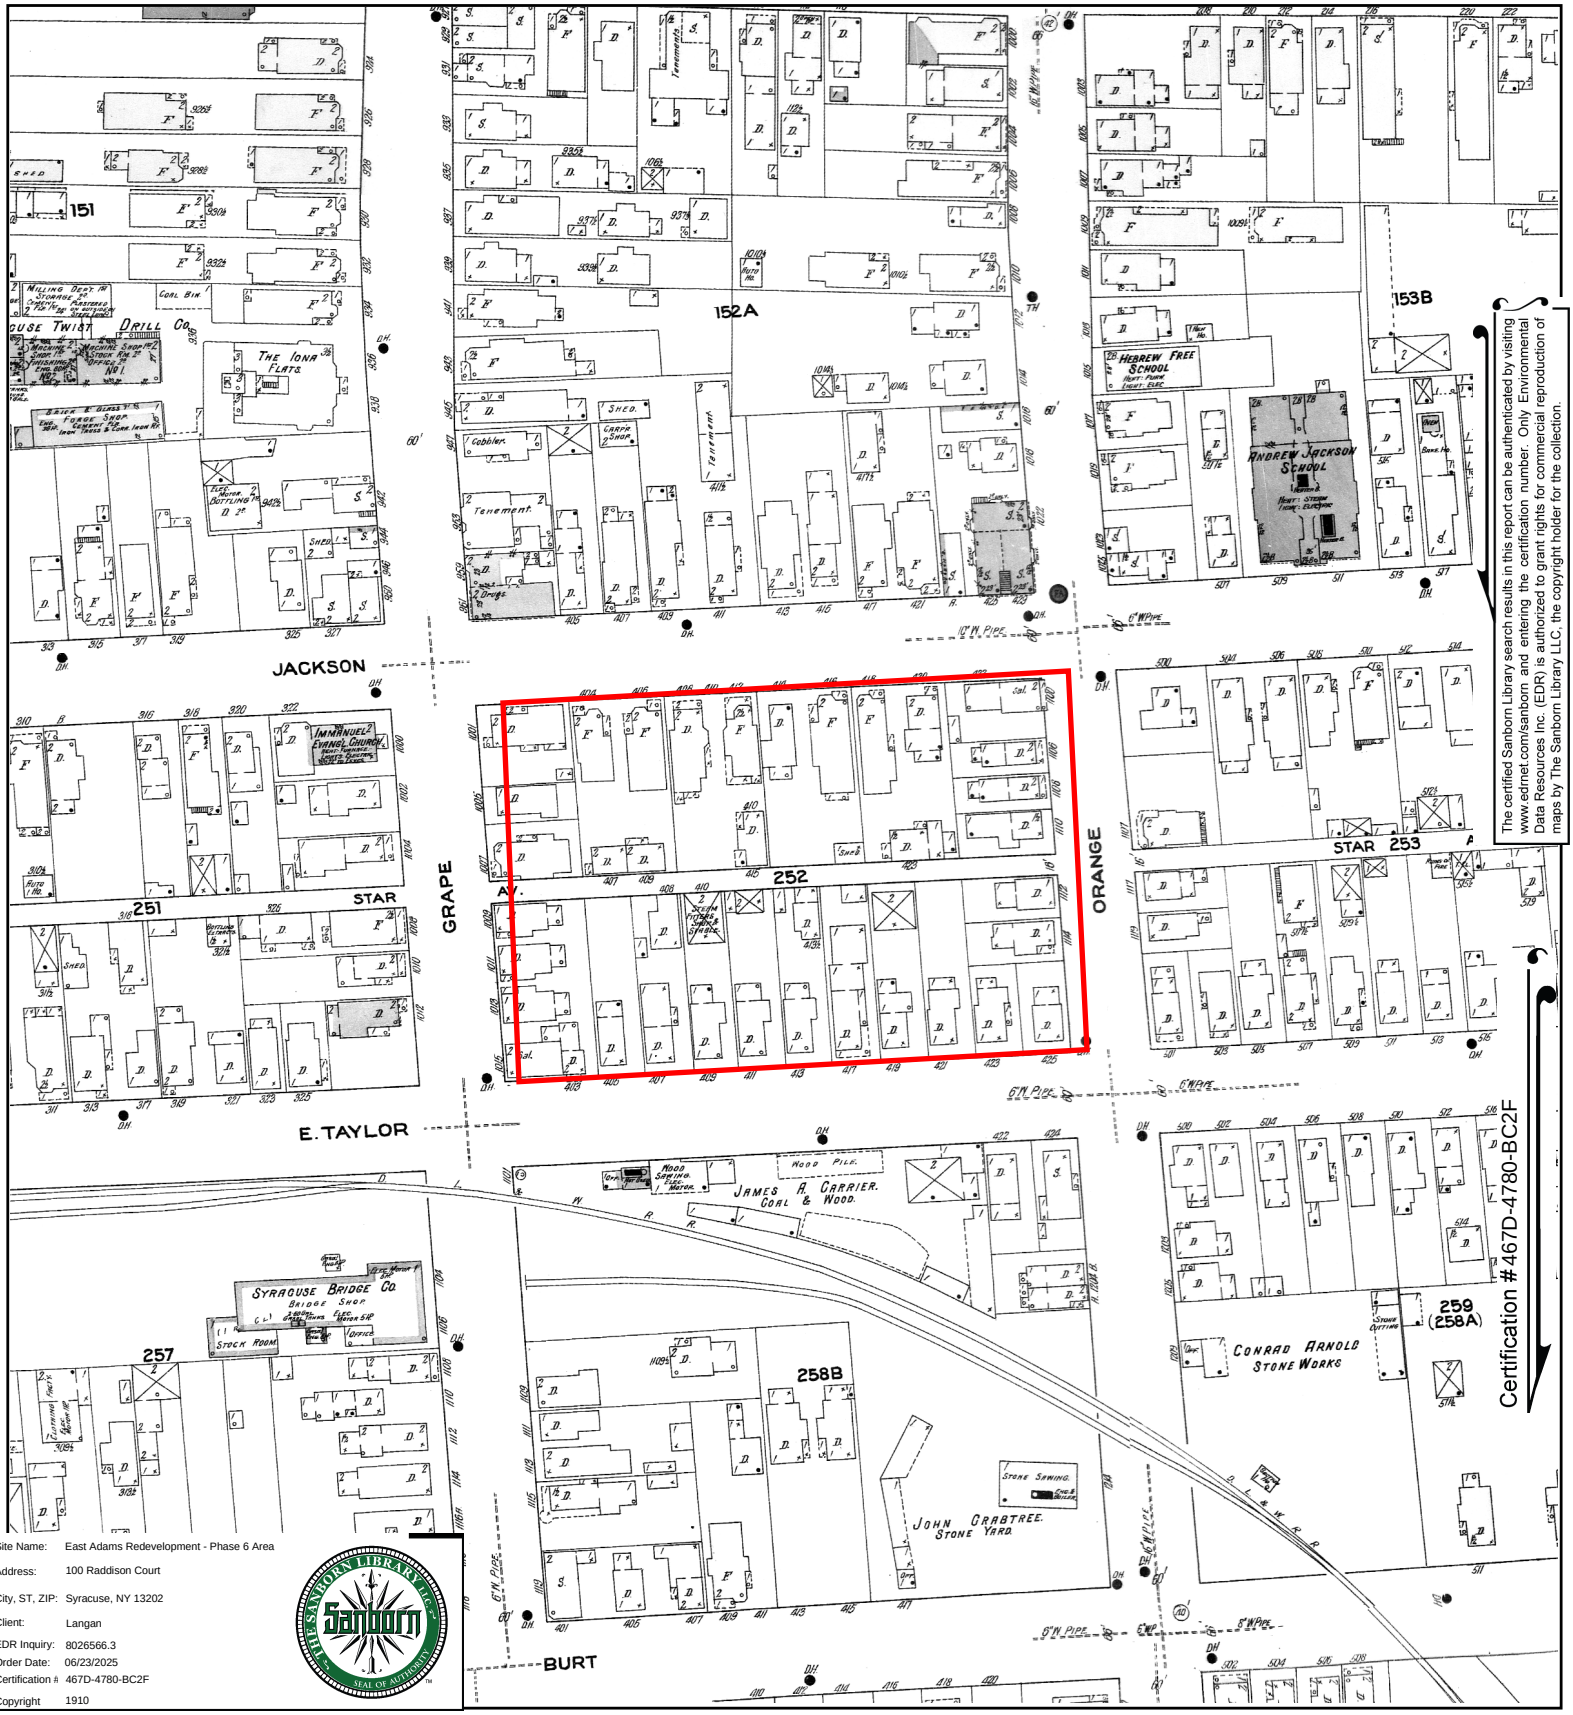

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	East Adams Redevelopment - Phase 6 Area
Address:	100 Raddison Court
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan
EDR Inquiry:	8026566.3
Order Date:	06/23/2025
Certification #:	467D-4780-BC2F
Copyright	1910

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

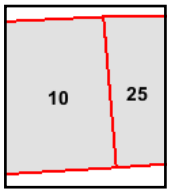

Volume 1, Sheet 25
Volume 1, Sheet 10

0 Feet 150 300 600

N

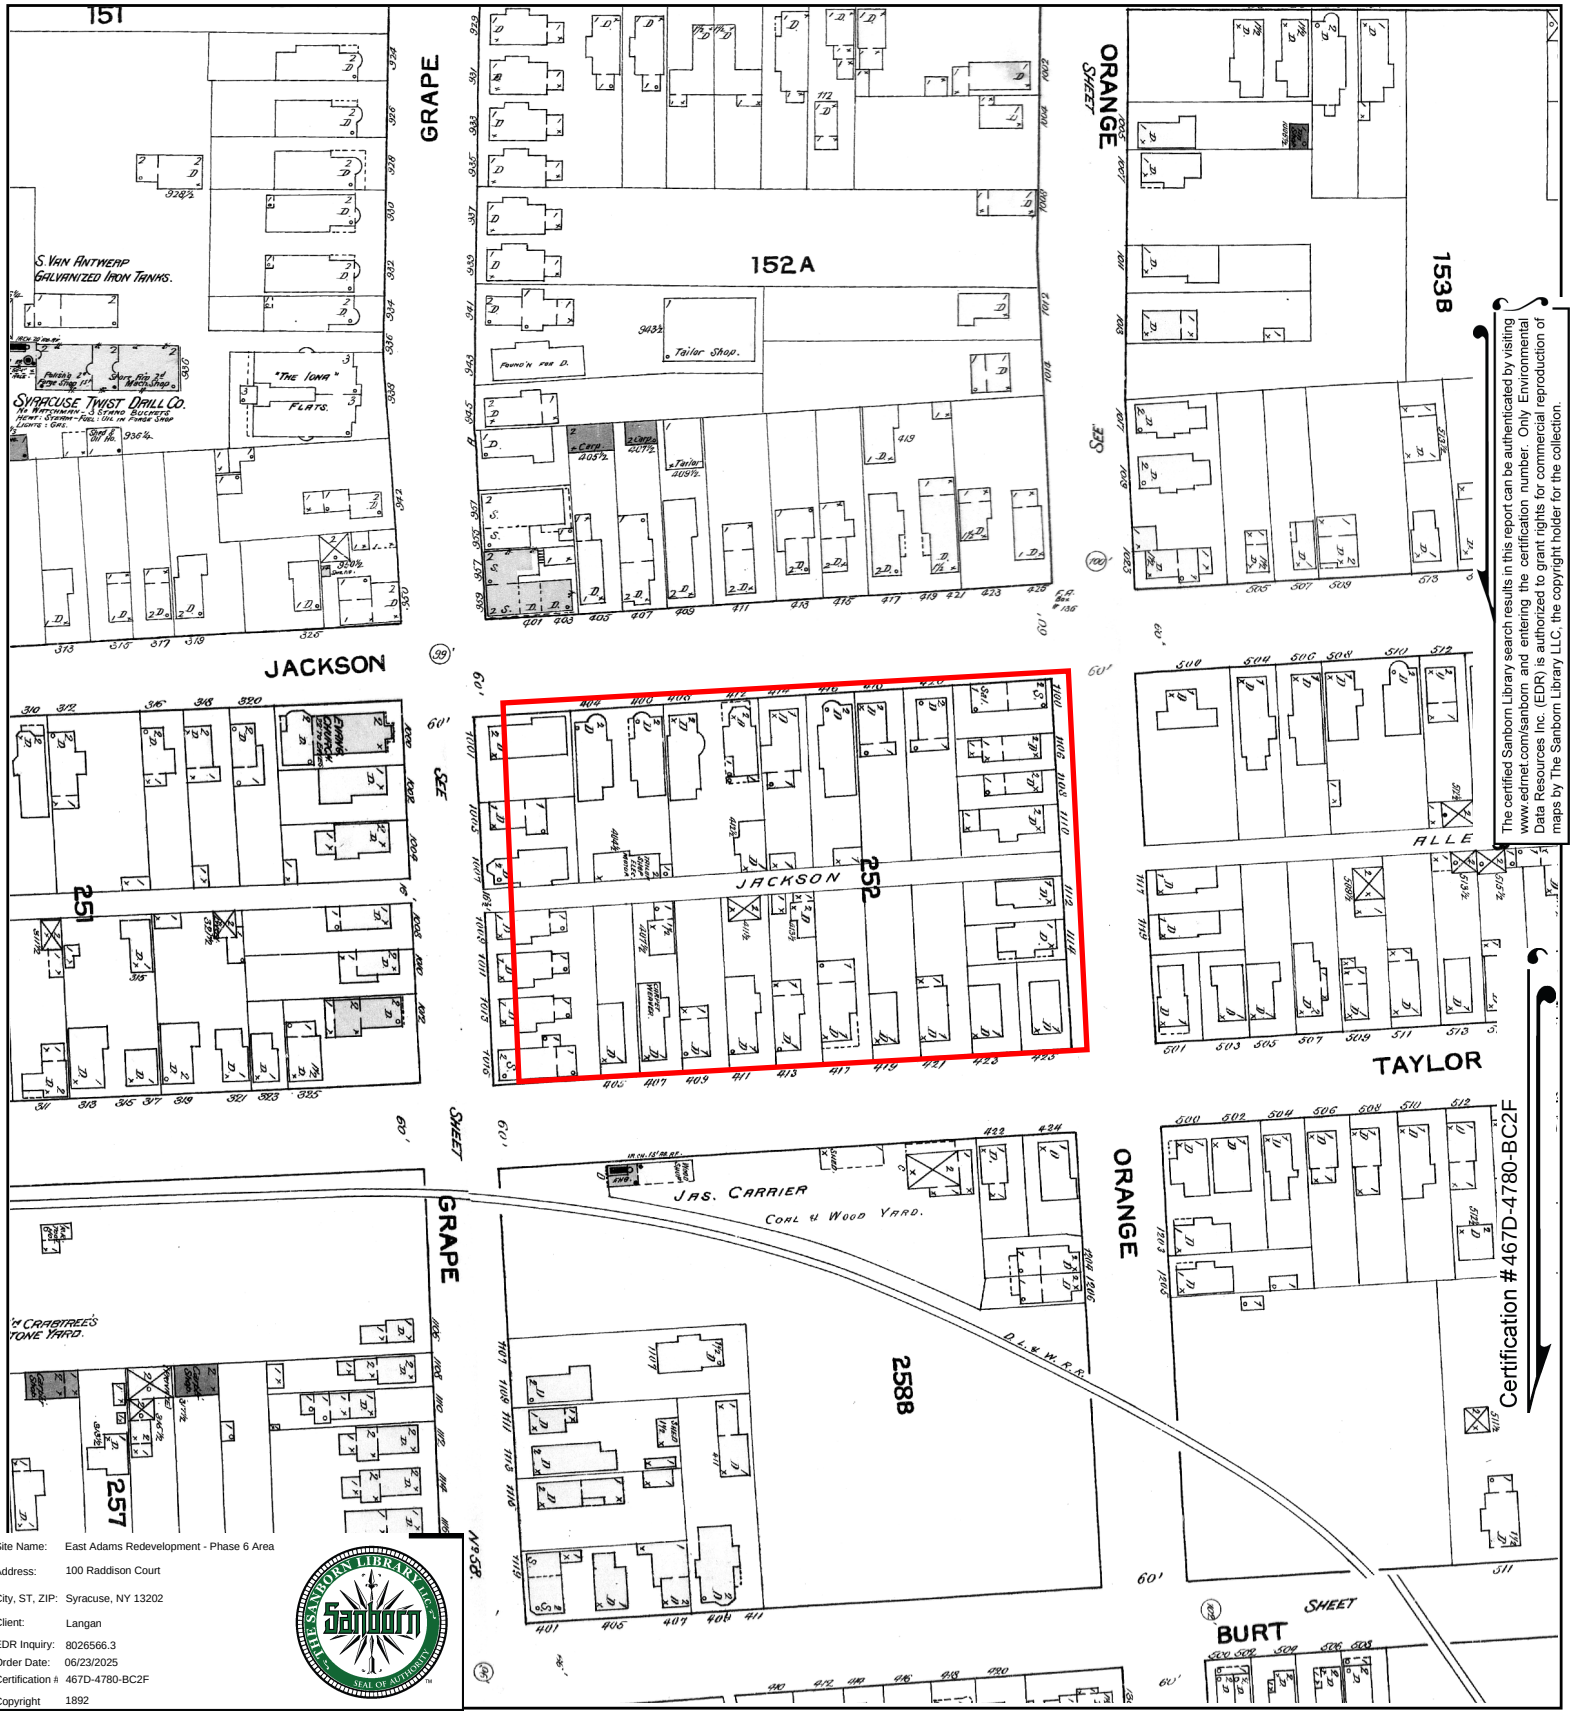

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #467D-4780-BC2F

Site Name:	East Adams Redevelopment - Phase 6 Area
Address:	100 Raddison Court
City, ST, ZIP:	Syracuse, NY 13202
Client:	Langan
EDR Inquiry:	8026566.3
Order Date:	06/23/2025
Certification #:	467D-4780-BC2F
Copyright	1892

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

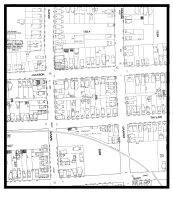

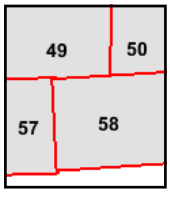

Volume 1, Sheet 50
Volume 1, Sheet 57
Volume 1, Sheet 49
Volume 1, Sheet 58

0 Feet 150 300 600

N

City Directory

East Adams Redevelopment - Phase 6 Area
100 Raddison Court
Syracuse, NY 13202

Inquiry Number: 8026566.5
June 25, 2025

The EDR-City Directory Image Report

EDR® Environmental Data Resources Inc

6 Armstrong Road
Shelton, CT 06484
800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION

Executive Summary

Findings

City Directory Images

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. **NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT.** Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2023 by Environmental Data Resources, LLC. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, LLC, or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Report is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Report includes a search of available business directory data at approximately five year intervals.

RECORD SOURCES

The EDR City Directory Report accesses a variety of business directory sources, including Haines, InfoUSA, Polk, Cole, Bresser, and Stewart. Listings marked as EDR Digital Archive access Cole and InfoUSA records. The various directory sources enhance and complement each other to provide a more thorough and accurate report.

EDR is licensed to reproduce certain City Directory works by the copyright holders of those works. The purchaser of this EDR City Directory Report may include it in report(s) delivered to a customer.

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. A check mark indicates where information was identified in the source and provided in this report.

Year	*Target Street*	*Cross Street*	*Source*
2020	☑	☐	EDR Digital Archive
2017	☑	☑	Cole Information
2014	☑	☐	Cole Information
2010	☑	☑	Cole Information
2005	☑	☑	Cole Information
2000	☑	☑	Cole Information
1995	☑	☑	Cole Information
1992	☑	☑	Cole Information
1988	☑	☑	Polk's City Directory
1983	☑	☑	Polk's City Directory
1977	☑	☑	Polk's City Directory
1972	☑	☑	Polk's City Directory
1968	☑	☑	Polk's City Directory
1964	☑	☑	Polk's City Directory
1959	☑	☑	Polk's City Directory
1955	☑	☑	Polk's City Directory
1949	☑	☑	Polk's City Directory
1944	☑	☑	Polk's City Directory
1939	☐	☑	Polk's City Directory

FINDINGS

TARGET PROPERTY STREET

100 Raddison Court
Syracuse, NY 13202

Year	*CD Image*	*Source*	
RADISSON CT			
2020	pg A1	EDR Digital Archive	
2017	pg A3	Cole Information	
2014	pg A4	Cole Information	
2010	pg A6	Cole Information	
2005	pg A8	Cole Information	
2000	pg A11	Cole Information	
1995	pg A13	Cole Information	
1992	pg A15	Cole Information	
1988	pg A17	Polk's City Directory	
1988	pg A18	Polk's City Directory	
1983	pg A20	Polk's City Directory	
1977	pg A23	Polk's City Directory	
1977	pg A24	Polk's City Directory	
1972	pg A26	Polk's City Directory	
1968	pg A29	Polk's City Directory	
1968	pg A30	Polk's City Directory	
1964	pg A32	Polk's City Directory	
1964	pg A33	Polk's City Directory	
1959	pg A35	Polk's City Directory	
1955	pg A38	Polk's City Directory	
1949	pg A41	Polk's City Directory	
1949	pg A42	Polk's City Directory	
1944	pg A44	Polk's City Directory	
1944	pg A45	Polk's City Directory	
1939	-	Polk's City Directory	Street not listed in Source

FINDINGS

CROSS STREETS

Year	*CD Image*	*Source*	
E TAYLOR ST			
1988	pg. A16	Polk's City Directory	
1983	pg. A19	Polk's City Directory	
1977	pg. A21	Polk's City Directory	
1977	pg. A22	Polk's City Directory	
1972	pg. A25	Polk's City Directory	
1968	pg. A27	Polk's City Directory	
1968	pg. A28	Polk's City Directory	
1964	pg. A31	Polk's City Directory	
1959	pg. A34	Polk's City Directory	
1955	pg. A36	Polk's City Directory	
1955	pg. A37	Polk's City Directory	
1949	pg. A39	Polk's City Directory	
1949	pg. A40	Polk's City Directory	
1944	pg. A43	Polk's City Directory	
1939	pg. A46	Polk's City Directory	
E TAYLOR ST			
2020	-	EDR Digital Archive	Target and Adjoining not listed in Source
2017	pg. A2	Cole Information	
2014	-	Cole Information	Target and Adjoining not listed in Source
2010	pg. A5	Cole Information	
2005	pg. A7	Cole Information	
2000	pg. A10	Cole Information	
1995	pg. A12	Cole Information	
1992	pg. A14	Cole Information	

City Directory Images

Target Street	Cross Street	Source
✓	-	EDR Digital Archive

RADISSON CT 2020

100	FRETONDA ADAMS
102	LEVOYA DIXON
103	JOHNNIE DRAKE
104	ALFRED THOMAS
	ANTHONY WEAKFALL
105	AUDREY POUNDS
106	SARAH HARRIS
108	DIANE SCOTT
	MAURICE FOXX
110	ANDRE STROMAN
	CHARLES STROMAN
	MARIE SMITH
111	ALVIN MCFADDEN
112	HEATHER LADUE
113	ASYRIA RUSH
	SAUDI CHIVALA
114	NAJIL TEARNEY
	RANDOLPH BAKER
	ZIKIA ALEXANDER
115	BEULAH HARGROVE
	FRANCHESKA FEBRES
	JANISE RAMBERT
	RYAN HORSFORD
116	DONSHAE BRITT
	SHERRY MASSEY
117	GLEN DICKERSON
	JANET LAWSON
	LATASHA WILLIAMS
	RICHARD IVEYS
	ROBBIN SLAUGHTER
118	CHATMON CHARLIE
	CHERYL ALLEN
	JARILKA SANTIAGO
	LOREZZ RILEY
	MARILYN HOWARD
	ORLANDO SULLIVAN
	SHAKAYSHA VANLOAN
	WAYNE ISAAC
119	BRENT REAVES
	CHAKA STEWART
	CORTEZ DALLAS
	FREDERICK EDWARDS
	JOHNNY CASANOVA
	LAMAR NEAL
	LANCE JOHNSON
	LEMANSKI THOMAS
	LOYDA CALDERON
	NASHYRA ODOMS
	SYRACUSE HOUSING AUTHORITY
	TOMMIE ADAMS

Target Street	Cross Street	Source
-	✓	Cole Information

E TAYLOR ST 2017

520 GE CONTRACTUAL SERVICES
PROJECT ORANGE ASSOCIATES

Target Street	Cross Street	Source
✓	-	Cole Information

RADISSON CT 2017

100	BURTON, WAYNE
101	FRAZIER, YASMINE
102	GARIA, JOLEANIA
103	DRAKE, JOHNNIE M
104	WEAKFALL, ANTHONY A
105	POUNDS, AUDREY E
106	HARRIS, SARAH M
107	MOORE, MARY E
108	SCOTT, DIANE
109	LANE, ROBERT L
110	STROMAN, ANDRE L
111	MCFADDEN, ALVIN
113	RUSH, ASYRIA S
114	ONESPHORE, BIMENYIMANA
116	GLOVER, WILLIE
	HILL, BARBARA J
	MASSEY, SHERRY A
	PACE, SHYKIEA
117	BLACKMON, JAMES C
	CIMINI, BRUCE W
	FELDER, CLARY
	INGRAM, EVA M
118	ALLEN, CHERYL G
	CHATMAN, CHARLIE
	SAMPSON, SHERWOOD
	WILLIAMS, ERIC C
119	ADAMS, TOMMIE L
	BELLAMY, TIMOTHY
	DALLAS, CORTEZ A
	FLAGG, ROBERT
	HOUSING AUTHORITY
	MOORE, SHAQUANA L
	ODOMS, NASHYRA
	STEWART, CHAKA N
	WHITE, LARRY

Target Street	Cross Street	Source
✓	-	Cole Information

RADISSON CT 2014

100	BALLARD, NICOLE
101	SAMOW, MOHAMED
102	HAJI, AMINA
103	DRAKE, JOHNNIE M
104	WEAKFALL, ANTHONY A
105	COSBY, KEYLO
106	HARRIS, SARAH M
109	LANE, ROBERT L
110	STROMAN, ANDRE L
111	MCFADDEN, ALVIN
113	CHIVALA, SAUDI
114	ONESPHORE, BIMENYIMANA
115	FEBRES, FRANCHESKA
	HARGROVE, BEULAH A
116	AUSTIN, TOM
	HILL, BARBARA J
	MASSEY, SHERRY A
	SCOTT, BETTY
	SMITH, TELESA A
117	CIMINI, BRUCE W
	INGRAM, EVA M
118	ALLEN, CHERYL
	FREEMAN, ARNOLD L
	MABRY, MARSHEEMA
	WILLIAMS, ERIC C
119	ADAMS, TOMMIE L
	BELLAMY, TIMOTHY
	BROWN, GREGORY H
	DALLAS, CORTEZ A
	DELANEY, JOHN
	HILL, TERRENCE
	MOORE, SHAQUANA L
	NELLONS, T
	STEWART, CHAKA N
	WHITE, LARRY

Target Street	Cross Street	Source
-	✓	Cole Information

E TAYLOR ST 2010

500 SYRACUSE UNIVERSITY SU STEAM
520 G E CONTRACTUAL SVC
PROJECT ORANGE ASSOC

Target Street	Cross Street	Source
✓	-	Cole Information

RADISSON CT 2010

100	BALLARD, NICOLE
101	CARRIE, GIBSON
102	HAJI, AMINA
103	DRAKE, JOHNNIE M
104	THOMAS, ALFRED J
105	FAULKER, JASHWA
106	HARRIS, SARAH M
107	OCCUPANT UNKNOWN,
108	SCOTT, DIANE
109	LANE, ROBERT
110	STROMAN, ANDRE
111	MCFADDEN, ALVIN
112	GONZALEZ, ROSA
113	CHIVALA, SAUDI
115	HARGROV, SATARIA
116	BRELAND, JUNIOR
	HILL, BARBARA
	MASSEY, SHERRY
	SCOTT, BETTY
	SMITH, TALISA
117	CIMINI, BRUCE W
	INGRAM, EVA M
118	ANDERSON, DAISY
	BETSEY-JONES, JIA
	BROWN, C
	CHESTNUT, LOUIS
	COOKE, JEROME C
	FITZGERALD, TUSHUA
	GRANT, MICHAEL
	ISAAC, WAYNE T
	JONES, SHARON L
	LUCAS, LUCINDA
	TAVERES, A
	WATSON, LAWRENCE
	WILSON, JOHNNIE
	WOOTEN, MICHELLE
119	BROWN, GREGORY
	CASANOVA, JOHNNY L
	DALLAS, CORTEZ
	DELANEY, JOHN
	HILL, TERRENCE
	JOHNSON, LANCE
	STEWART, CHAKA
	WHITE, LARRY

Target Street	Cross Street	Source
-	✓	Cole Information

E TAYLOR ST 2005

500 SYRACUSE UNIVERSITY
520 GE CONTRACTUAL SERVICES
GENERAL ELECTRIC INTERNATIONAL INC
PROJECT ORANGE ASSOCIATES LLC

Target Street	Cross Street	Source
✓	-	Cole Information

RADISSON CT 2005

100	BALLARD, ALICE G
101	CARRIE, GIBSON
102	JACKSON, SPRING L
103	DRAKE, JOHNNIE M
104	DAVIS, MATTIE
105	COSBY, KEYLO
106	HARRIS, SARAH M
107	OCCUPANT UNKNOWN,
108	THOMPSON, SHIRLEY
110	STROMAN, ANDRE
111	MCFADDEN, ALVIN
112	ZAMORA, PABLO
113	MONROE, JAMIE
114	BAKER, GLADYS
115	LAMBERT, J
116	BRELAND, JUNIOR
	BREWER, TIMOTHY E
	BROOKS, UNIQUA
	CAGE, XICA Q
	CONAWAY, EARL
	FOUNTAINE, DENISE
	HILL, BARBARA
	SMITH, T
117	BRAYBOY, ANTHONY
	CIMINI, BRUCE W
	HUNTER, D
	INGRAM, EVA M
	IVEYS, RICHARD
	RICHARDS, NICOLE
118	ALEXANDER, WALTER L
	ATTAWAY, S
	BAXTER, DAMON
	BROWN, C
	CHARLES, DEVON
	HICKS, AHMAD
	JONES, DERRICK
	RIVERS, ANDREW
	SUKATI, LINDIWE
	TAVERAS, ADOLFO
	TAVERES, A
	WILLIAMS, K
	WILSON, JOHNNIE
119	ADAMS, JUN
	BAKER, LAVOR
	BAKERS, LAVAR
	GADSON, QUIANA
	JAMISON, MELVIN
	KUINONES, VICTOR
	LEE, RAHKISHA
	LITTLE, KELVIN

Target Street	Cross Street	Source
✓	-	Cole Information

RADISSON CT 2005 (Cont'd)

119	MCASTER, D
	MOORE, SHAQUANA
	SIMMONS, MARIE
	SMITH, TALENA
	STROMAN, C
	WALLACE, SARAH E
	WHITE, LARRY
	WILSON, TAMMISH
	YARBROUGH, ANIKA

Target Street	Cross Street	Source
-	✓	Cole Information

E TAYLOR ST 2000

520 S & S ENERGY PRODUCTS PROJECT ORANGE FACILITY

Target Street	Cross Street	Source
✓	-	Cole Information

RADISSON CT 2000

100	JONES, M L
101	OCCUPANT UNKNOWN,
102	OCCUPANT UNKNOWN,
103	DRAKE, JOHNNIE M
104	DAVIS, MATTIE
105	OCCUPANT UNKNOWN,
106	HARRIS, SARAH M
107	HUDDLESTON, ANDREW C
108	OCCUPANT UNKNOWN,
109	OCCUPANT UNKNOWN,
110	OCCUPANT UNKNOWN,
111	SHERMAN, C
112	OCCUPANT UNKNOWN,
114	ALDAMUY, EDWINA
115	OCCUPANT UNKNOWN,
116	BRELAND, JUNIOR
	BREWER, T E
	SCOTT, BETTY
	WILEY, ZINA
117	BLACKMON, ANTHONY D
	CIMINI, BRUCE
	INGRAM, EVA M
	TITUS, ADANMA N
118	ROBINSON, LARRY
	TORRENCE, SHAKINA
	WILSON, JOHNNIE
119	DAVIS, D
	JAMISON, MELVIN
	SHEPHERD, T
	SKIPPER, DAVID

Target Street	Cross Street	Source
-	✓	Cole Information

E TAYLOR ST 1995

301	BETSEY, KATE
	JACOBS, D D
303	SMALLS, RICHARD
305	BARNETT, KENDALL
307	ROBERTS, JAY D
309	BYNOE, EDWIN N
	DURHAM, THELMA
520	STEWART & STEVENSON OPERATIONS INC

Target Street	Cross Street	Source
✓	-	Cole Information

RADISSON CT 1995

100	JONES, M L
101	LEE, T
102	RODGERS, LEROY R
103	DRAKE, JOHNNIE MAE
104	CARMAN, OLLIE
105	LEGETTE, JANICE
106	HARRIS, SARAH M
108	HOLLOWAY, LEE
109	SPINKS, HENRY L
115	BROOKS, Q
116	BRELAND, JUNIOR
	HARRIS, MARY
	JENNINGS, J
	SIMMONS, MARGARET
117	INGRAM, EVA MAE
118	BALLARD CONSTR CO
119	BLACK, EUGENE WALTER
	HARRIS, WILBURT
	JOHNSON, C
	LITTLE, COMYIA
	MADDOCK, LINDA
	SKIPPER, DAVID

Target Street	Cross Street	Source
-	✓	Cole Information

E TAYLOR ST 1992

301	BETSEY, KATE
303	FAIR, THERESA
305	JONES, MAMIE
307	ROBERTS, JAY D
309	BYNOE, EDWIN N
	TILLIE, HELEN
	WHITE, ALMA
311	TORRES, ELIAS
500	CENTURY CONTRACTORS WEST INC
	DELLOVADE A C
	STEWART STEVENSON OPERATIONS INC

Target Street	Cross Street	Source
✓	-	Cole Information

RADISSON CT 1992

101	BASS, MARY
102	DRAKE, JOHNNIE MAE
103	LITTLE, V
105	HARRISON, MARY
106	HARRIS, SARAH M
109	SPINKS, HENRY L
111	JOHNSON, JANIE M
112	WILLIAMS, ROBIN
115	CLEMMONS, DORIS
116	BRELAND, JUNIOR
	HARRIS, MARY
	SIMMONS, MARGARET
117	INGRAM, EVA MAE
	POTTS, OPHELIA
118	WILLIAMS, DEREK
119	WRIGHT, WHITNEY

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1988

69

TAYLOR ST EAST –FROM 901 SOUTH SALINA EAST TO 400 RENWICK AV

ZIP CODE 13202
MONTGOMERY ST INTERSECTS
S STATE ST INTERSECTS

78

SOUTH TOWNSEND ENDS
OAKWOOD AV BEGINS
RADISSON CT ENDS
SOUTH MC BRIDE INTERSECTS
cor Wilson Playground (side ent)
500 Syr University Steam Station
INTERSTATE 81 EXPWY INTERSECTS
ALMONDS ST INTERSECTS
GAGE CT BEGINS

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1988

78-A

RADISSON CT –FROM JACKSON WEST OF S MC BRIDE SOUTH TO W TAYLOR ST

ZIP CODE 13202

Pioneer Homes (Housing Project)

100 Munger Clara
101 Bass Mary L 422-7901
102 Drake Johnnie Mae Mrs 471-2470
103 Little Venus M
104 Jessie Lillie 472-7381
105 Harrison Mary D Mrs 478-1043
106 Harris Sarah M 475-5039

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1988

107 Moore Mary E Mrs 476-3555
108 Porch Willie 471-5028
109 Spinks Henry L 472-7680
110 Vacant
111 Johnson Willie 475-8600
112 Murray Elizabeth
113 Horton Linda
114 Holmes Peggy
115 Clemons Doris Mrs 476-3092
116 Apartments
A Simmons Margt 471-2558
B Vacant
C Vacant
D Ransom Ruby 476-6698
E Harris Mary M 422-8829
F★Mallory Jane R Mrs
117 Apartments
A Vacant
B Ingram Eva M Mrs 475-7546
C★Braver F
D Vacant
E Cimini Bruce
F Williams James E
118 Apartments
A★Walker Jas A
B Gathers Fred 425-9831
C Vacant
D No Return
E Townsley Emanuel 472-6003
F Vacant
G Beakes Wilbert
H Wallace Delores 478-5038
I Paterson Shirlynn
J Breland Junior 478-5445
K Seward Andrew
L Vacant
119 Apartments
A Frank Lenora 476-2465
B Vacant
C Jackson Elaine
D Smith Bennie
E Green Mark 478-6714
F Blakley Tina 478-7141
G Wright Donald
H Odams Nancy
I Jones Willis
J Thomas Bobby R 422-7459
K Bodley Raymond
L Vacant

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1983

69

TAYLOR ST EAST --FROM 901 SOUTH
SALINA EAST TO 400 RENWICK AV

ZIP CODE 13202
MONTGOMERY ST INTERSECTS
S STATE ST INTERSECTS

78

SOUTH TOWNSEND ENDS
OAKWOOD AV BEGINS
RADISSON CT ENDS
SOUTH MC BRIDE INTERSECTS
cor Wilson Playground
500 Syr University Steam Station
INTERSTATE 81 EXPWY INTERSECTS
ALMONDS ST INTERSECTS
GAGE CT BEGINS

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1983

RADISSON CT —FROM JACKSON WEST OF S MC BRIDE SOUTH TO W TAYLOR ST

ZIP CODE 13202
Pioneer Homes (Housing Project)
100★Fielder Anna
101★Bass Mary
102 Drake Johnnie Mae Mrs 471-2470
103 Little V 471-5574
104★Jessie Lillie 472-7381
105★Harrison Mary Mrs 478-1043
106★Harris Sarah M 475-5039
107 Moore Mary E Mrs
108 Porch Willie
109 Spinks Henry L 472-7680
110 Stanley John B 472-1714
111 Johnson Willie 475-8600
112 Murray Elizabeth
113★Jones Cynthia
114 Jones Mary Ann 422-6427
115★Clemons Doris Mrs
116 Apartments
A★Riley Silas
B Fowler Shelton
C Blackshear Douglas 476-1067
D Ransom R
E Harris Mary M 478-6064
F Baker Eug
117 Apartments
A Hines Mary L
B Ingram Eva M Mrs 475-7546
C Williams Beatrice R Mrs
D Potts Ophelia Mrs 475-9537
E★Wise Vivian 475-4584
F Vacant
118 Apartments
A Vacant
B Vacant
C June Waymond
D Eady Mary
E Townsley Emanuel
F Vacant
G★Rhodes Melvin
H★Macken Ella Mae 476-3629
I Woodard Alwiller Mrs 478-3440
J★Breland Junior 478-5445
K Seward Andrew
L★Tape Louis
119 Apartments
A Frank Lenora
B Albanese Nikki 428-1431
C Mc Clure Wilson 476-7715
D★Smith Bennie
E Odoms Willie
F Brown Bishop
G Jamison Jake 425-9096
H Tolbert Betty Mae
I★Muldrow Helen
J Sterling Virginia
K Owens Asreen
L Cox Wallace

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1977

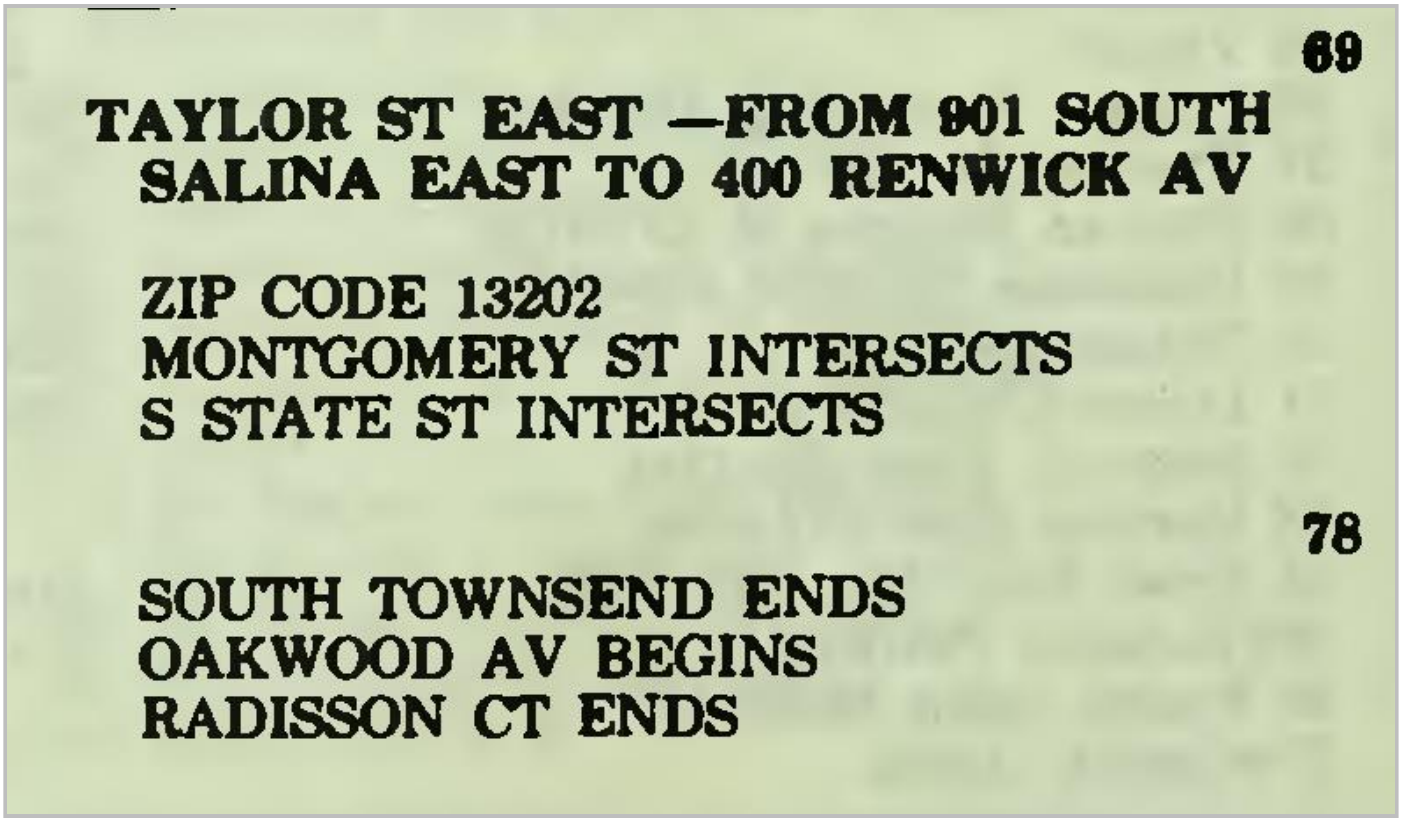

69

TAYLOR ST EAST —FROM 901 SOUTH
SALINA EAST TO 400 RENWICK AV

ZIP CODE 13202
MONTGOMERY ST INTERSECTS
S STATE ST INTERSECTS

78

SOUTH TOWNSEND ENDS
OAKWOOD AV BEGINS
RADISSON CT ENDS

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1977

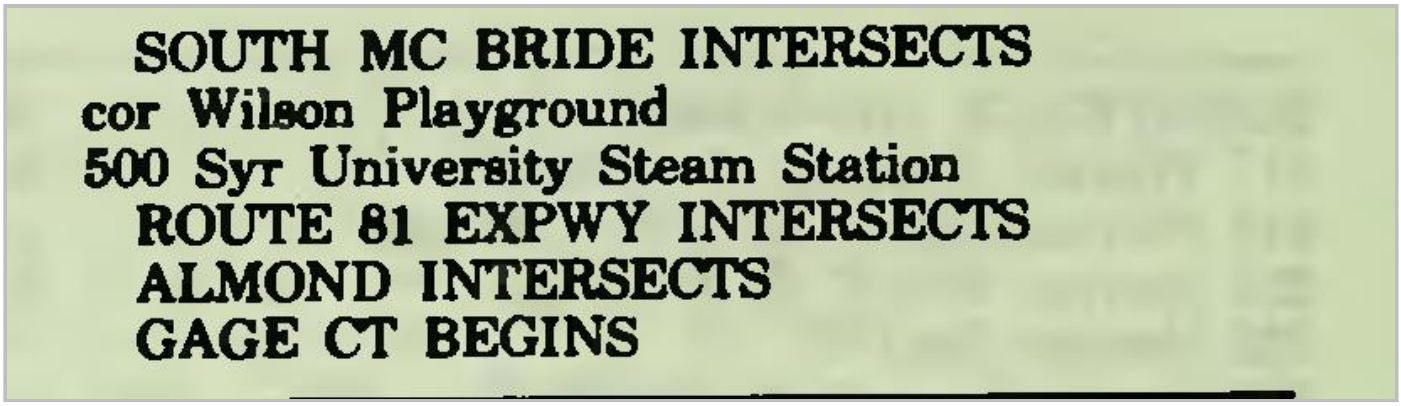

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1977

RADISSON CT —FROM JACKSON WEST OF S MC BRIDE SOUTH TO W TAYLOR ST

ZIP CODE 13202

Pioneer Homes (Housing Project)

100 Rogers Lovie Mrs 471-2553
101 Wiggins Arth 471-6770
102 Drake Johnnie Mae Mrs 471-2470
103 Allen Benj Rev
104 Perry Ruby Mrs 479-8305
105 Harrison Mary Mrs 478-1043
106 Gray Carrie Mrs 476-0706
107 Moore Mary E Mrs 476-6558
108 Whitson Clara Mrs 478-3588
109 Panther May 478-1021
110 Stanley John B 472-1714
111 Johnson Willie 475-8600
112 Roberts Georgette A Mrs 476-6734
113 Davis Leroy 471-1852
114 Jones Mary Ann 422-6427
115 Shepherd Johnnie Belle Mrs
116 Apartments
A★Fitzgerald Loretta Mrs

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1977

RADISSON CT—Contd

B Fowler Shelton
C Blackshear Douglas 476-1067
D Ransom R
E Harris Mary M 478-6064
F Robinson Virginie Mrs

117 Apartments
A★Williams Robt
B Ingram Eva M Mrs 475-7546
C Williams Beatrice R Mrs
D Potts Ophelia Mrs 475-9537
E Wise Vivian Mrs 475-4584
F Reese Charlie 475-2907

118 Apartments
A★Herron Alonzo 478-4483
B Vaughn Minnie Mrs 478-3583
C Robinson Nathan R 476-0260
D Bennett Fredk
E Vacant
F Vann Bessie Mrs 478-3495
G Rivers Glenn
H★Mackin Ella
I Woodard Alwiller Mrs 478-3440
J★Smith E 471-2334
K Seward Andrew
L★Emanuel W

119 Apartments
A Frank Lenora
B Vassar Walter 478-4584
C Mc Clure Wilson 476-7715
D Barnes Julia A 474-4744
E Laidley Benj 479-5418
F★Clay Ethel R 475-9440
G Knight Hattie Mrs 478-7417
H Irons Bertha Mrs
I Ellison Saml 476-3529
J Rivers Ann Mrs 478-8821
K Vacant (2 Apts K-L)

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1972

69

TAYLOR ST EAST —FROM 901 SOUTH SALINA EAST TO 400 RENWICK AV

ZIP CODE 13202
MONTGOMERY ST INTERSECTS
S STATE ST INTERSECTS

78

SOUTH TOWNSEND ENDS
OAKWOOD AV BEGINS
SOUTH MC BRIDE INTERSECTS
cor Wilson Playground
500 Syr University Steam Station

70

ROUTE 81 EXPWY INTERSECTS
ALMOND INTERSECTS
GAGE CT BEGINS

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1972

RADISSON CT —FROM JACKSON WEST OF S MC BRIDE SOUTH

ZIP CODE 13202

100 Huntley Laura Mrs 478-7467
101 Moss Annie D Mrs 476-2756
102 Drake Johnnie Mae Mrs 475-1083
103 Allen Benj Rev 478-6022
104 Vacant
105 Harrison Mary Mrs 478-1043
106 Gray Carrie Mrs 476-0706
107 Moore Mary E Mrs
108 Whitson Clara Mrs 478-3588
109 Brown Missouri Mrs 472-0673
110 Stanley John B 472-1714
111 Walker Julius
112 Scott Johnnie B Mrs 476-4783
113 Campbell Alfonso 475-1525
114 Gaines Pamela Mrs 472-0873
115 No Return
116 Apartments
A Charity Marie Mrs 476-0706
B Fowler Shelton
C Vacant
D Rivers Florence A Mrs 476-5472
E Harris Mary M 478-6064
F Pyzatte Edw
117 Apartments
A Shaw Mary Mrs
B Ingram Eva M Mrs
C Scott Frank B 479-7420
D Potts Ophelia Mrs 475-9537
E Wise Vivian Mrs 475-4584
F Milburn Nellie Mrs 476-4937
118 Apartments
A Jones Mary L 478-3669
B Vaughn Minnie Mrs 478-3583
C Robinson Nathan R 476-0260
D Evans Caleb 474-2372
E Williams Leroy 476-6681
F Vann Bessie Mrs 478-3495
G Pemberton Willie 476-8269
H Brainard Flora L 476-6742
I Woodard Alwiller Mrs 478-3440
J Herron Alonzo 478-4483
K Raus John T 475-1070
L Seals Charles 474-5567
119 Apartments
A Frank Lenora
B Vassar Willie 478-4584
C Mc Clure Wilson
D Barnes Julia A 474-4744
E Laidley Benj 479-5418
F Vassar Gertrude
G Knight Hattie Mrs
H Irons Bertha Mrs
1 Ellison Saml 476-3529
J Jackson Orin 478-5006
K Vacant
L Holmes Washington 478-5698

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1968

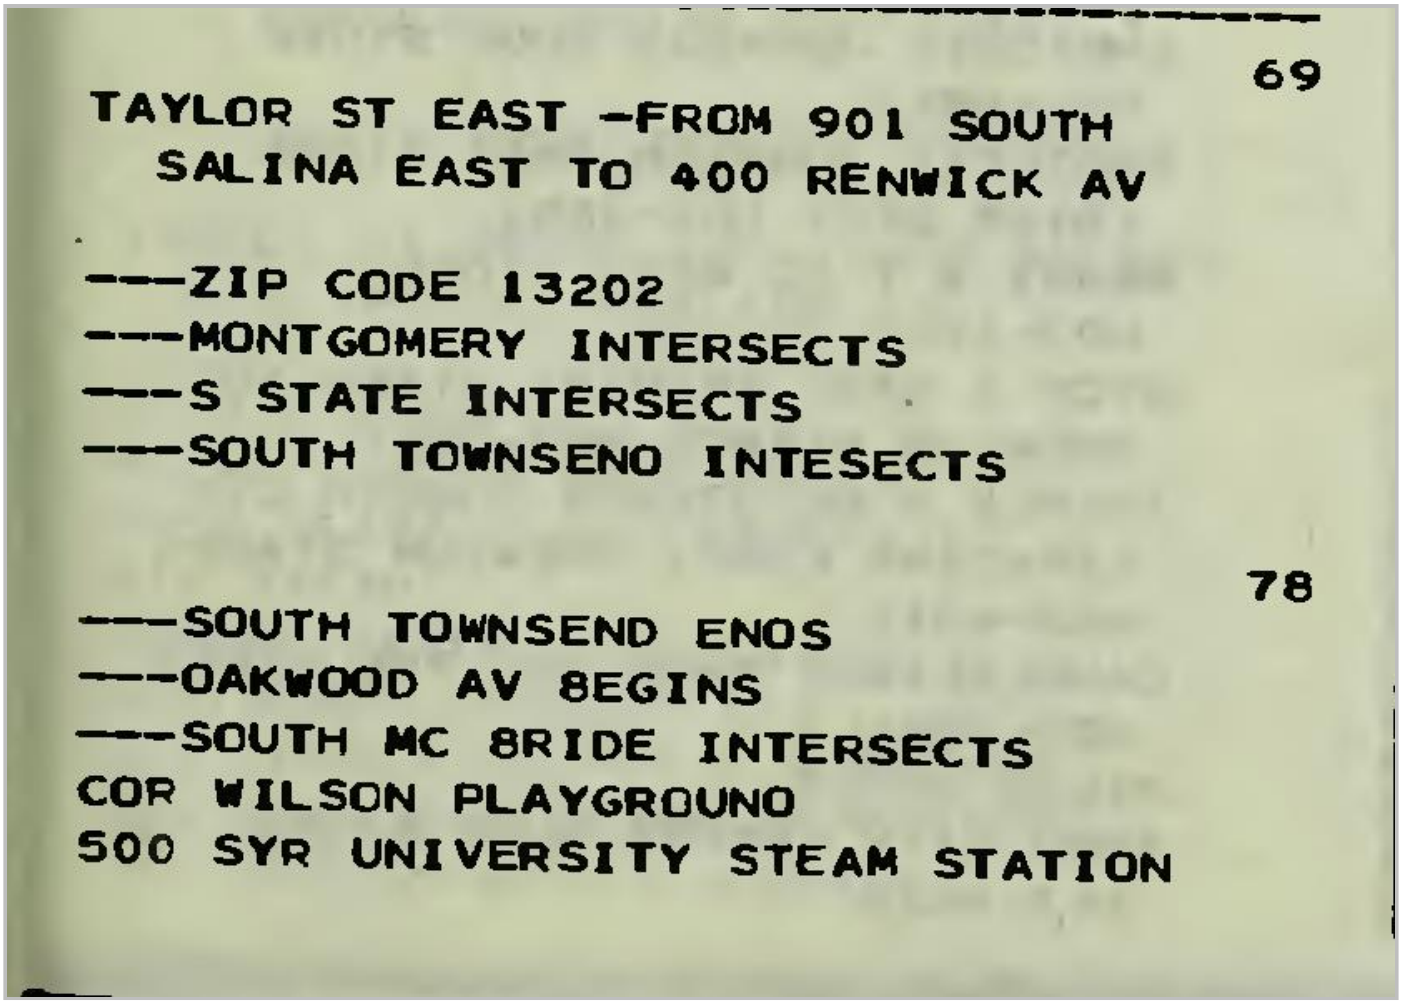

69

TAYLOR ST EAST -FROM 901 SOUTH
SALINA EAST TO 400 RENWICK AV

---ZIP CODE 13202
---MONTGOMERY INTERSECTS
---S STATE INTERSECTS
---SOUTH TOWNSENO INTESECTS

78

---SOUTH TOWNSEND ENOS
---OAKWOOD AV 8EGINS
---SOUTH MC 8RIDE INTERSECTS
COR WILSON PLAYGROUNO
500 SYR UNIVERSITY STEAM STATION

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1968

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1968

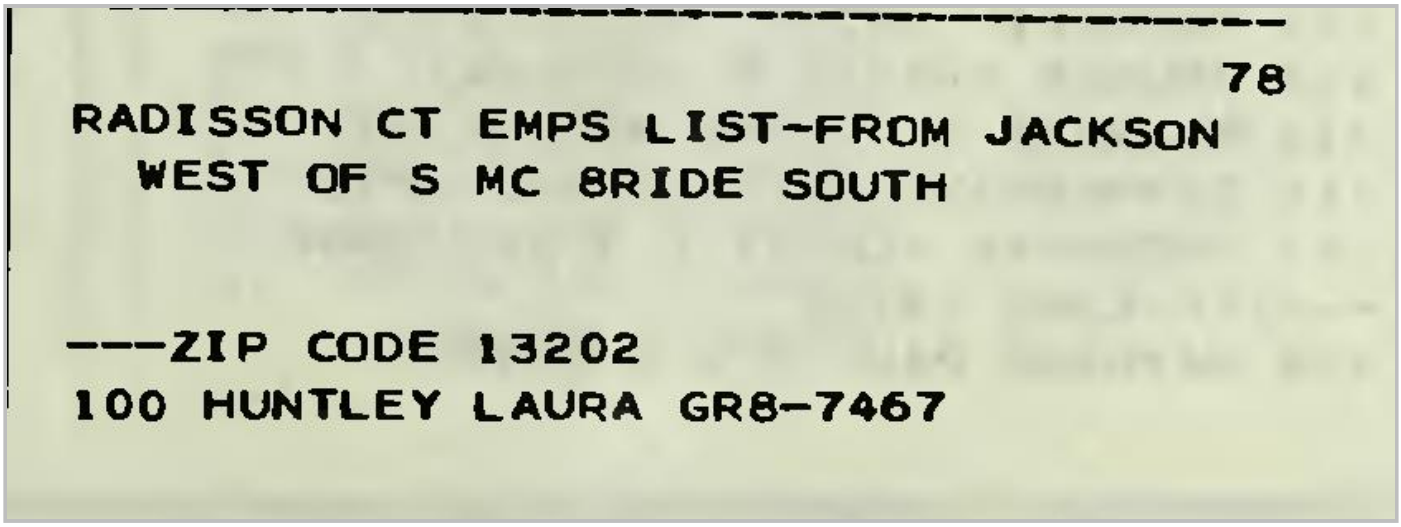

78

RADISSON CT EMPS LIST-FROM JACKSON
WEST OF S MC 8RIDE SOUTH

---ZIP CODE 13202
100 HUNTLEY LAURA GR8-7467

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1968

RADISSON CT EMPS LIST--CONTD

101 MOSS CLARENCE 476-2756
102 DRAKE JOHNNIE MAE MRS 475-1083
103 HUNTLEY KENNETH
104 DAVIS JIMMIE L 475-2389
105 EDWARDS JO ANNE MRS 479-6976
106 GRAY CARRIE MRS GR6-0706
107 MOORE MARY MRS
108 WHITSON CLARA MRS 478-3588
109 ROSS CHARITY MRS 478-4218
110 STANLEY JOHN B 472-1714
111 GAINES PERCOLIA MRS 472-0873
112 SCOTT JOHNNIE MRS GR6-4783
113 SHELLMAN JOSEPH
114 LOVE BARNEY 475-7846
115 SHELLMAN BERTHA M MRS
116 APARTMENTS
A YOUNG MARY L MRS GR6-8023
B BACHUS DAVID GR5-6849
C LAWRENCE JESSE GR8-1842
D RIVERS FLORENCE A MRS GR6-5472
E HARRIS MARY M 478-6064
F PYZATTE EDW
STREET CONTINUED
117 APARTMENTS
A WAGNER TILLAR 478-4659
B GIBSON LULU MRS
C DERBY EMILY R MRS
D PAVLOVITZ PAULINE MRS 478-3780
E WISE VIVIAN MRS
F MILBURN NELLIE MRS 476-4937
STREET CONTINUED
118 APARTMENTS
A JONES MARY L GR8-3669
B VAUGHN MINNIE MRS GR8-3583
C ROBINSON NATHAN R 476-0260
D VACANT
E CALDWELL CONSTANCE E MRS GR6-6762
F RENDER HELEN MRS 478-7363
G PEMBERTON WILLIE
H BRAINARD FLORA L GR6-6742
I WOODARD ALWILLER GR8-3440
J VANN BESSIE MRS
K COB JOHN
L SEALS CHARLES
STREET CONTINUED
119 APARTMENTS
A BROWN EONA GR6-7655
B WASHINGTON ANNIE MRS 476-1228
C WILSON ANTHONY B
D ALSTON MALVINA 476-8830
E JOSEY RUTH F MRS
F CAMPBELL MARY MRS
G KNIGHT HATTIE MRS
H IRONS BERTHA MRS
I JACKSON EDNA MRS 476-7745
J COOPER JULIA H MRS
K LAIDLEY BENJ
L HOLMES WASHINGTON

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1964

69

TAYLOR ST EAST -FROM 901 SOUTH
SALINA EAST TO 400 RENWICK AV

---MONTGOMERY INTERSECTS
201 VACANT
203 BAR8IERI LOUIS
---SOUTH STATE INTERSECTS

78

---SOTH TOWNSEND INTERSECTS
---OAKWODD AV 8EGINS
---SOUTH MC BRIOE INTERSECTS
COR WILSON PLAYGROUND
500 SYR UNIVERSITY STEAM STATION
520 JACKSON AUGUSTA MRS 476-0835
VACANT
SIMMONS PEGGY MRS GR5-1302
GRIFFIN JAMES JR GR5-0795

79

---ALMDND INTERSECTS
600 VACANT
VACANT
601 SYR HOUSING PROJECT
602 PULLINS HENRY
VACANT
BAILEY LULA MRS
602½ VACANT
604 MATTHEWS WELLINGTON
GLENN DECORIS 475-6610
606 DUN8AR CURTIS 478-0759
608 PAM LORETTA 478-2401
610 ROTHROCK CONSTANCE MRS GR5-9186
LEONARD RANOOLPH • 476-6748

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1964

RADISSON CT -FROM JACKSDN SOUTH

100 HUNTLEY LAURA GR8-7467
101 AIKEN LEONARD E 475-1901
102 ROHADFOX MANNIE GR6-5627
103 HUNTLEY KENNETH
104 BENJAMIN EMMA
105 EDWARDS LUTHER
106 GRAY CARRIE MRS GR6-0706
107 MOORE MARY MRS
108 TREASURE ROSE MRS 476-7073
109 ROSS CHARITY MRS 478-4218
110 BOOG ANNA F
111 GAINES PECOLIA
112 SCOTT JOHNNIE MRS GR6-4783
113 VACANT
114 WILLIAMS MARGT MRS GR8-5482
115 SHELLMAN BERTHA GR5-3025
116 APARTMENTS
A YOUNG MARY L MRS GR6-8023
B BACHUS OAVID GR5-6849
C LAWRENCE JESSE GR8-1842

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1964

D RIVERS FLORENCE MRS GR6-5472
E ANDERSON ERNESTINE MRS
475-1132
F TROTMAN MICHL
STREET CONTINUED

117 APARTMENTS
A DENNIS SAM GR8-4483
B DICKSON EUNICE GR5-6220
C CATHCART JAMES GR8-5922
D PAVLOVITZ ANTHONY 478-3780
E BRODKS ROBT L GR5-9128
F GLENN DECORIS 475-7723
STREET CONTINUED

118 APARTMENTS
A JONES MARY L GR8-3669
B VAUGHN MINNIE MRS GR8-3583
C FARRARO NICHOLAS 475-2430
D ALEXANDER LAURA M MRS
GR6-3508
E CALDWELL CONSTANCE E MRS
GR6-6762
F WHEELER LENA GR5-7398
G VAN SLYKE EDNA MRS GR6-8276
H BRAINARD FLORA L GR6-6742
I WOODARD ALWILLER GR8-3440
J MOODY ANN
K HOPPE ALMA A MRS 476-6929
L HALETSKY JOSEPH GR5-2470
STREET CONTINUED

119 APARTMENTS
A HAAS ANNA MRS
B SHARP ARTH
C GIBSON LULU 476-7397
D ALSTON MALVINA 476-8830
E JOSEY RUTH F MRS
F CAMPBELL MARY MRS
G KINGDESKI MARY MRS GR5-2955
H IRONS BERTHA MRS
I SIMPSON RACHEL MRS GR8-2539
J BROWN EDNA GR6-7655
K BENJAMIN JOHN
L MEYER GERTRUDE GR8-6583
STREET CONTINUED

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1959

EAST TAYLOR STREET—From 901 S Salina east to 400 Renwick av, wds 9, 15, 18, Map L 9-10, Zone 3
E Salina bus to beginning, E Colvin bus to 400

109 Cree Jos W 1 ◎ ΔGR5-8280
Buss Harold 2
Abbott Clark 2
111 Vacant
113 Beshaw Clara L Mrs 1 ΔGR6-6541
Griffith Edna May Mrs 1
LaPoint Geo 2 ΔGR6-6413

Montgomery st crosses

203 Barbieri Louis
205 Voutsinas Gregory D 1
Voutsinas Andrew 2 ◎ ΔGR6-6157
207 Kuhn Ida Mrs ◎ ΔGR5-6833

S State st crosses
S Townsend st crosses

305 McKinney Fred 2 ΔGR6-2740
307 Jones Earl F
309 Williams John ◎ ΔGR6-4896
311 Fitzhugh Richd H ΔGR6-0359
313 Hanford Allie Mrs ΔGR5-9559
315½ Price Ezzie ΔGR5-8407
317 Rucker Stokes 1 ΔGR6-9612
Grace Ceasar 2 ΔGR6-1834
319 Seymore Carrina 1
Rhodes Pauline Mrs 1
Overton Levina 2

Oakwood av begins

321 Scammell Douglas F ◎ ΔGR5-2605
323 Burwell Kenneth ◎
325 Boston Beatrice ◎

S McBride st crosses

400 Syracuse Housing Project
405 to 423 Syracuse Housing Project

— Wilson Playground

McBride crosses

500 Syracuse University Steam Station
518 Burke Georgia Mrs
Pittman Eddie Lee
520 Jones Ulysses 1 ΔGR5-9663
Roberts Georgette Mrs 1 ΔGR6-6951
Simmons Peggy Mrs 2 ΔGR5-1302
Griffin Jimmie jr 2 ΔGR8-6650

Almond st crosses

600 Moore Mary D Mrs 1 ΔGR5-2702
Graham Geo W 2
601-15 Syracuse Housing Project
602 Dixon Theo 1 ΔGR8-3713
Moody Clarence 1 ΔGR8-4477
Werts Eleanor Mrs 2 ΔGR6-4977
Jackson Sam L 2 ΔGR5-0714
602½ rear Dunbar Curtis
604 Zendle Nathan ◎ ΔGR6-8801
White Lula Mae Mrs
606 Walton Nelson ΔGR6-3601
608 McKeller Jas E ΔGR5-5441
610 Rockrock Constance Mrs 1 ΔGR5-6770
Brooks Mattie M Mrs 2

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1959

RADISSON COURT—From Jackson st south, wd 9, Map L 10, Zone 3

E Colvin bus

100 Wentworth Louis G 1
101 Anderson Laura Mrs 1 ΔGR6-0257
102 Rohadfox Mannie 2 ΔGR6-5627
103 Bunbrage Jobie 2
104 Stallings Effie Mrs 2 ΔGR5-4504
105 Adams Stanley E 2 ΔGR8-1767
106 Gray Winfield 1
107 Jackson Donald 1 ΔGR6-8916
108 Lonzara Nicholas 1
109 Battle June Mrs 1 ΔGR6-2687
110 Boog Paul M 2
111 Vacant
112 Vacant
113 Tucker Catherine Mrs 2
114 Williams Margt Mrs 1 ΔGR8-5482
115 Weed Kathleen Mrs 1
116 **Apartments**
(A) Kenny Hattie Mae
(B) Paris Jane Mrs ΔGR8-7888
(C) Fontenot Helen Mrs ΔGR5-0356
(D) Rivers Florence A Mrs ΔGR6-5472
(E) Johnson Ernestine Mrs
(F) Daniels Altamease E Mrs
117 **Apartments**
(A) Dennis Sam
(B) Bolden Irene Mrs
(C) Henty Lillian B Mrs
(D) Pavlovitz Anthony
(E) Seay Earie Mrs ΔGR6-3954
(F) Pinkard Georgianna Mrs ΔGR8-3964
118 **Apartments**
(A) Bowman Laura Mrs ΔGR6-2616
(B) Vaughn Minnie Mrs
(C) Dunn Thos L
(D) Alexander Laura M Mrs
(E) Caldwell Constance E Mrs ΔGR6-7198
(F) Wheeler Lena R Mrs ΔGR5-7398
(G) VanSlyke Edna Mrs ΔGR6-8276
(H) Brainard Flora ΔGR6-1389
(I) Spaulding Geraldine L Mrs
(J) Render Helen Mrs
(K) Hoppe Alma A Mrs
(L) Haletsky Jos ΔGR5-2470
119 **Apartments**
(A) Haas Anna Mrs
(B) Sharp Arth
(C) Parlin Elmer E ΔGR5-1407
(D) Houser Christine L Mrs
(E) Togias Zoi Mrs ΔGR6-8741
(F) Landers Brayton ΔGR6-6726
(G) Kingdeski John ΔGR5-7255
(H) Irons Bertha Mrs
(I) Allen John H
(J) Bunkoff Frances Mrs ΔGR5-8658
(K) Bailey Frankie
(L) Diggins Thos

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1955

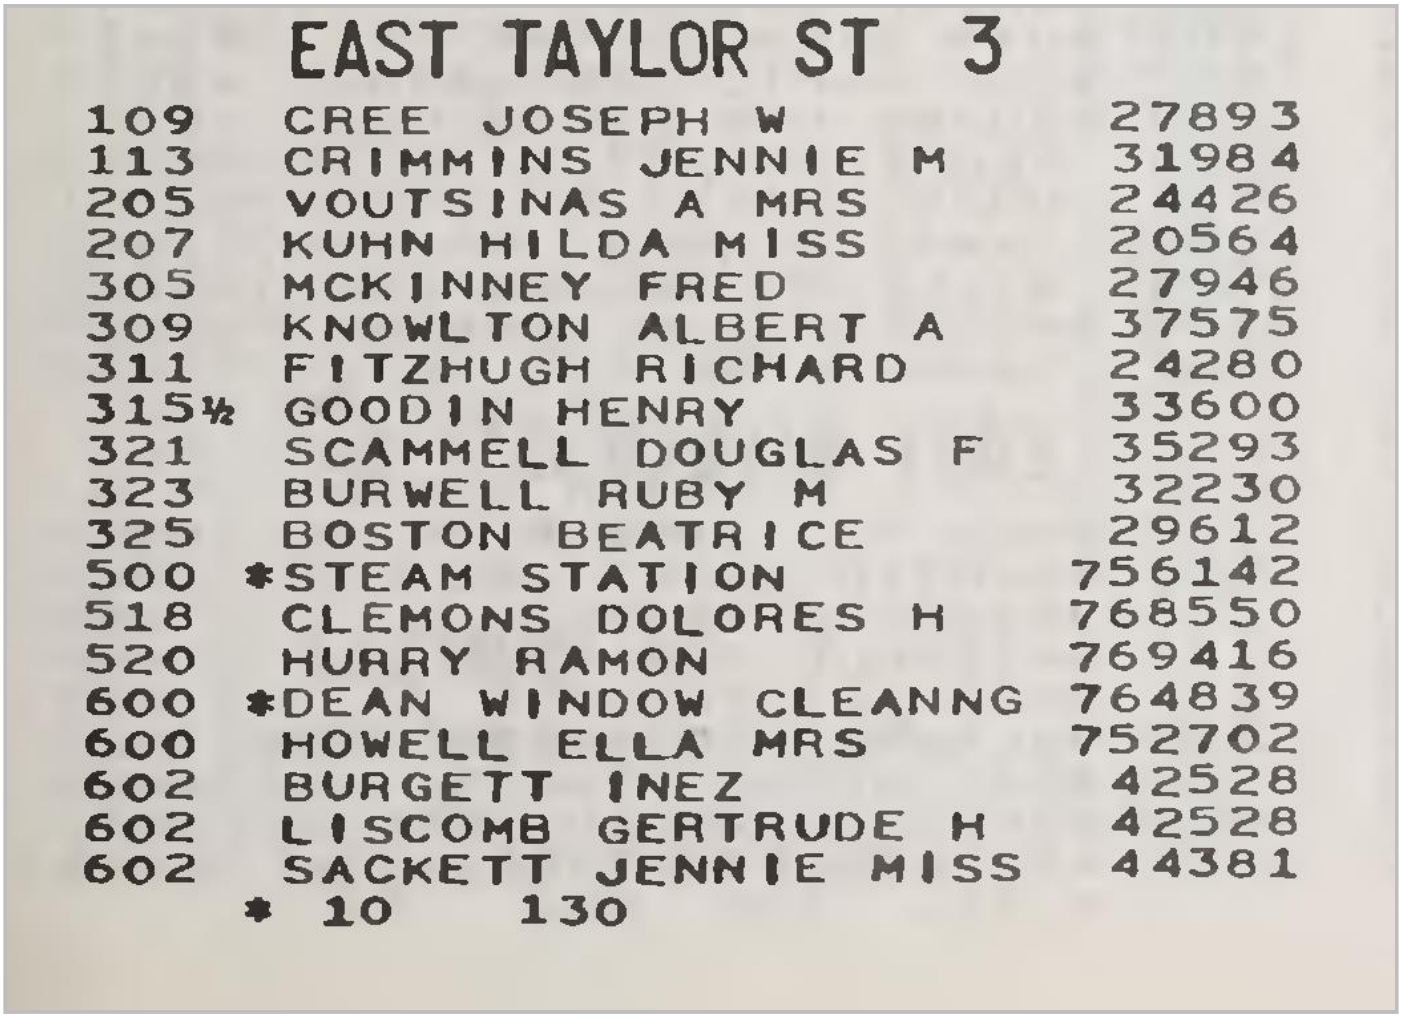

EAST TAYLOR ST 3

109	CREE JOSEPH W	27893
113	CRIMMINS JENNIE M	31984
205	VOUTSINAS A MRS	24426
207	KUHN HILDA MISS	20564
305	MCKINNEY FRED	27946
309	KNOWLTON ALBERT A	37575
311	FITZHUGH RICHARD	24280
315½	GOODIN HENRY	33600
321	SCAMMELL DOUGLAS F	35293
323	BURWELL RUBY M	32230
325	BOSTON BEATRICE	29612
500	*STEAM STATION	756142
518	CLEMONS DOLORES H	768550
520	HURRY RAMON	769416
600	*DEAN WINDOW CLEANNG	764839
600	HOWELL ELLA MRS	752702
602	BURGETT INEZ	42528
602	LISCOMB GERTRUDE H	42528
602	SACKETT JENNIE MISS	44381

* 10 130

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1955

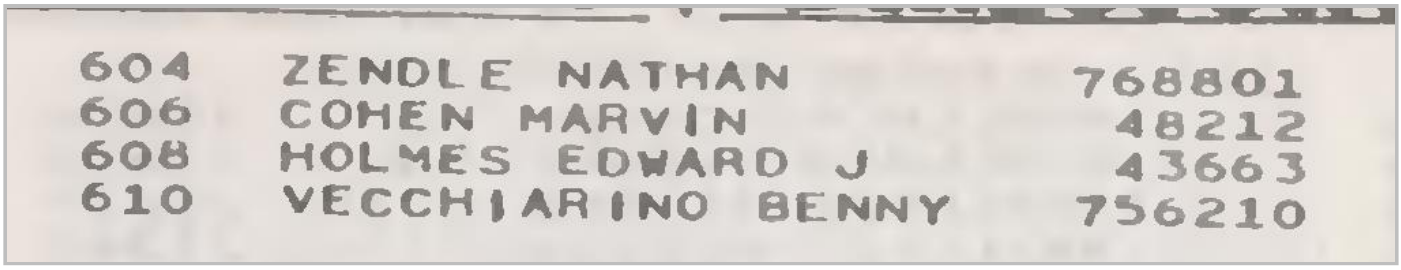

604	ZENDLE NATHAN	768801
606	COHEN MARVIN	48212
608	HOLMES EDWARD J	43663
610	VECCHIARINO BENNY	756210

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1955

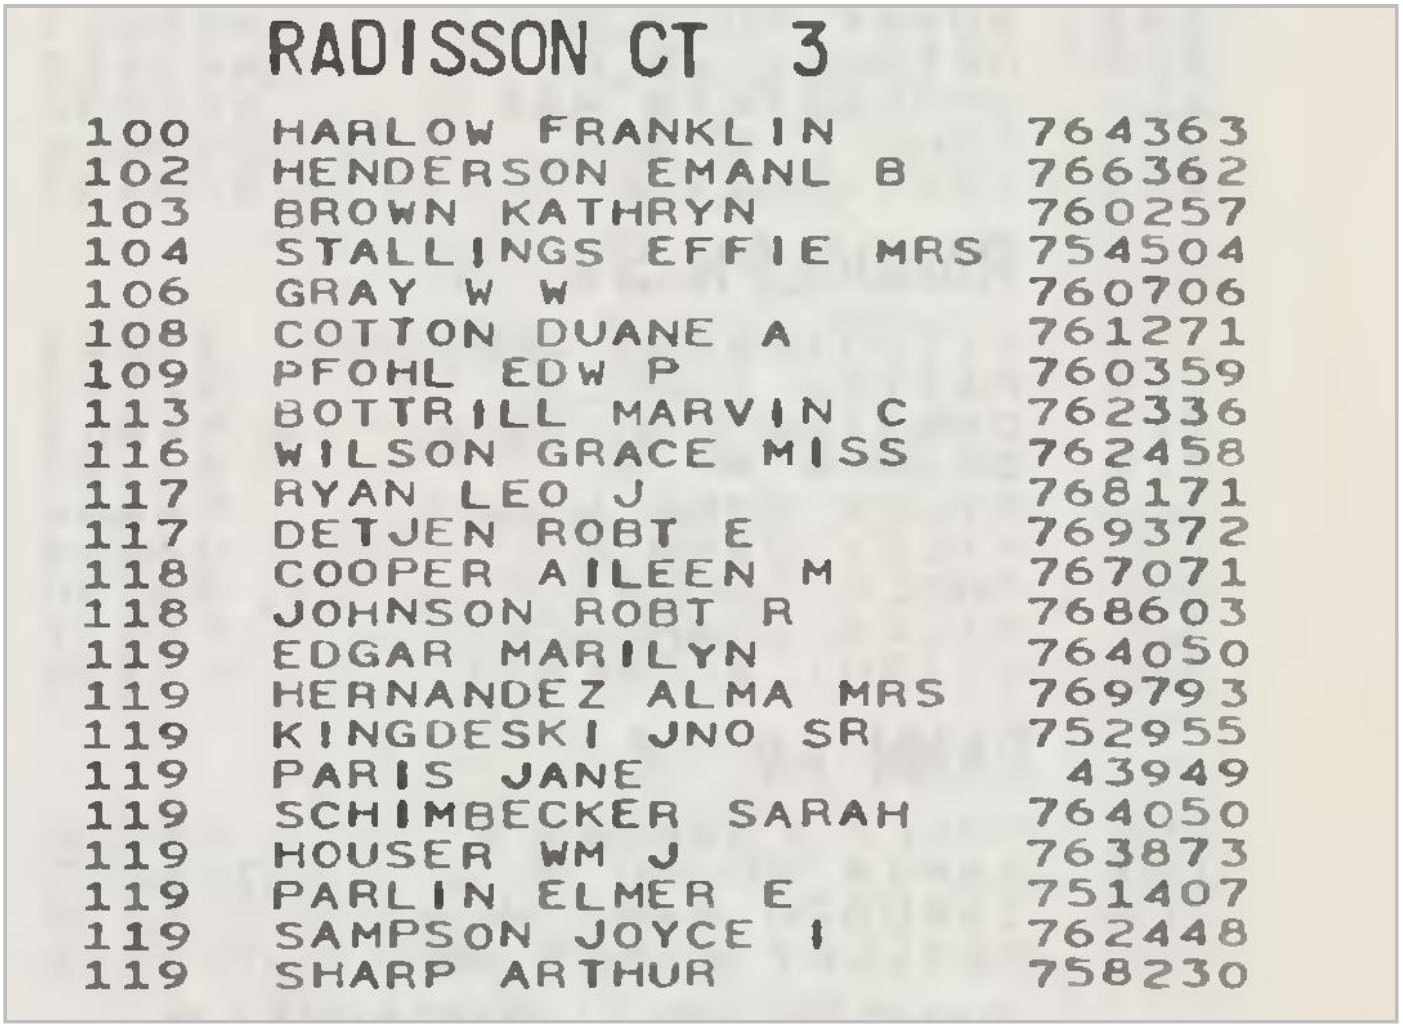

RADISSON CT 3

100	HARLOW FRANKLIN	764363
102	HENDERSON EMANL B	766362
103	BROWN KATHRYN	760257
104	STALLINGS EFFIE MRS	754504
106	GRAY W W	760706
108	COTTON DUANE A	761271
109	PFOHL EDW P	760359
113	BOTTRILL MARVIN C	762336
116	WILSON GRACE MISS	762458
117	RYAN LEO J	768171
117	DETJEN ROBT E	769372
118	COOPER AILEEN M	767071
118	JOHNSON ROBT R	768603
119	EDGAR MARILYN	764050
119	HERNANDEZ ALMA MRS	769793
119	KINGDESKI JNO SR	752955
119	PARIS JANE	43949
119	SCHIMBECKER SARAH	764050
119	HOUSER WM J	763873
119	PARLIN ELMER E	751407
119	SAMPSON JOYCE I	762448
119	SHARP ARTHUR	758230

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1949

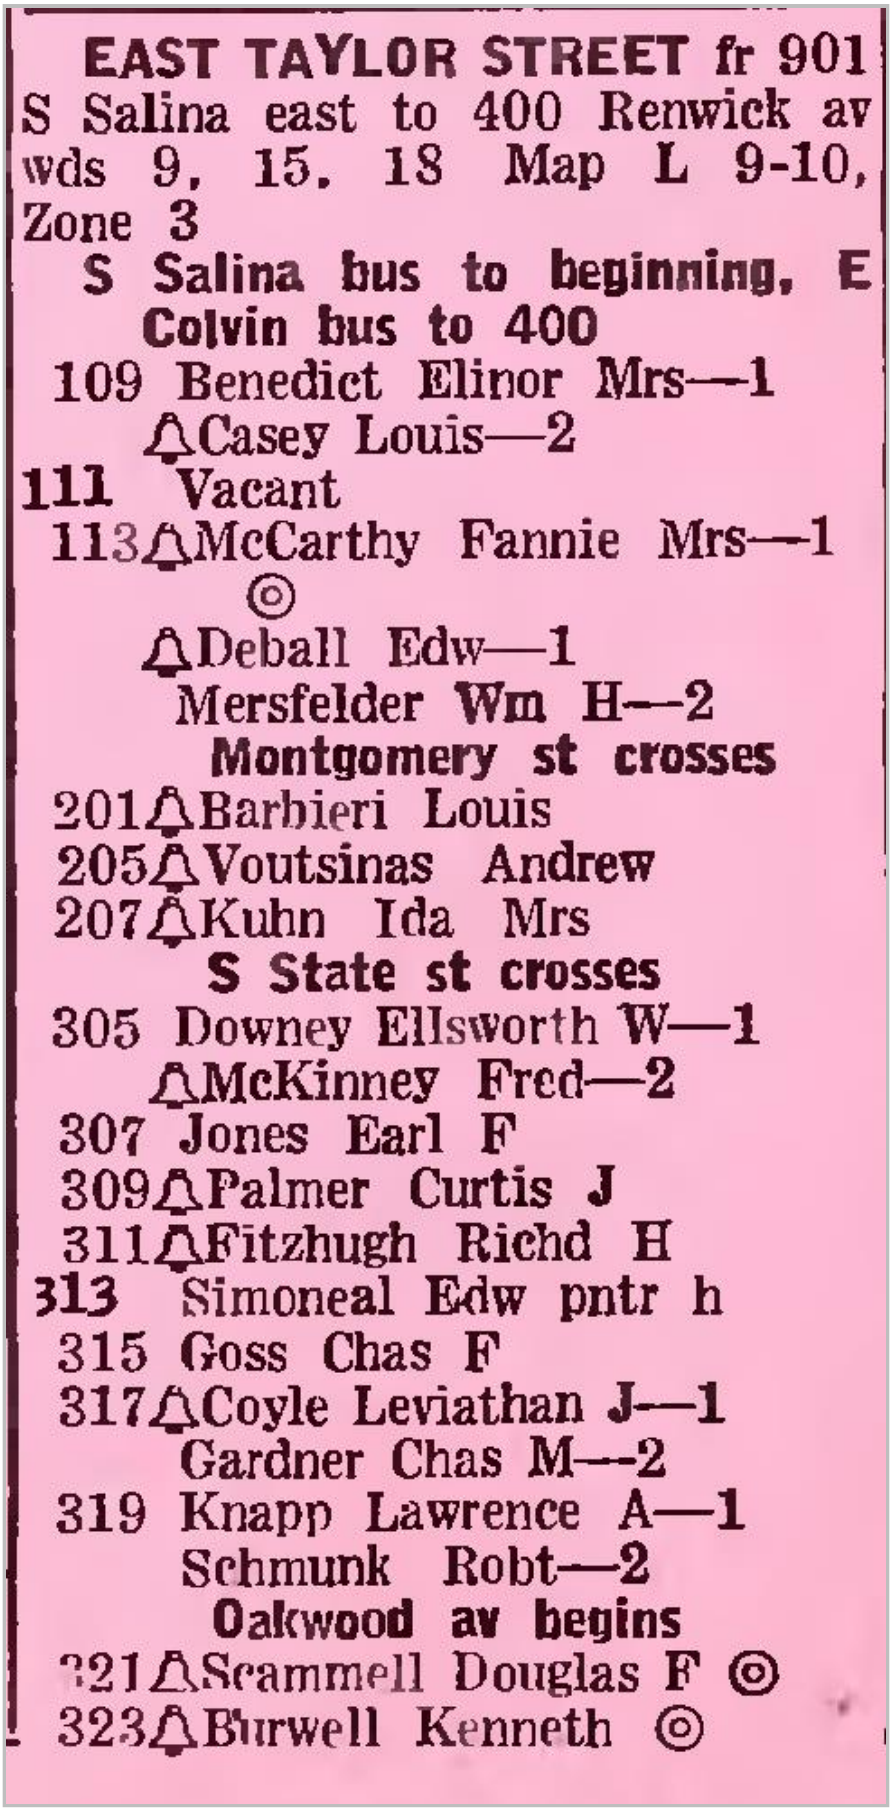

EAST TAYLOR STREET fr 901
S Salina east to 400 Renwick av
wds 9, 15, 18 Map L 9-10,
Zone 3
S Salina bus to beginning, E Colvin bus to 400
109 Benedict Elinor Mrs—1
Casey Louis—2
111 Vacant
113 McCarthy Fannie Mrs—1
◎
Deball Edw—1
Mersfelder Wm H—2
Montgomery st crosses
201 Barbieri Louis
205 Voutsinas Andrew
207 Kuhn Ida Mrs
S State st crosses
305 Downey Ellsworth W—1
McKinney Fred—2
307 Jones Earl F
309 Palmer Curtis J
311 Fitzhugh Richd H
313 Simoneal Edw pntr h
315 Goss Chas F
317 Coyle Leviathan J—1
Gardner Chas M—2
319 Knapp Lawrence A—1
Schmunk Robt—2
Oakwood av begins
321 Scammell Douglas F ◎
323 Burwell Kenneth ◎

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1949

325 StAndrews Francis J
S Townsend st ends
405 to 423 Syracuse Housing Project
Wilson Playground
S McBride st crosses
Gage ct begins
502 Curtis Lena M Mrs
504 Donohue Mary Mrs
506 Miller Carl K junk h ◎
508 Nowek Isadore
510 Vacant
511 Muehlenbein Wm
512 Shulman Clement—1 ◎ ◎
Schwartzberg Maurice H —2
516 Ellison Saml junk h
518 Supiro Julius ◎
rear Warren Ardeen
520 Prouty Chester—1
Paoletti Paul A—1
Christe Elmer D—2
Homer Peter

Almond st crosses

600 Moore Mary D Mrs—1
Vacant—2
601-615 Syracuse Housing Project
602 Guarino Frank—1
Burgett Inez Mrs—1
Atwater Geo—2
Moza Felix—2
604 Vacant store
Zendle Nathan ◎
Brown Amos
606 Cohen Jacob ◎
608 Holmes Edw J mason contractor h
610 Vecchiarino Benj—1
Stein Jessie—2

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1949

RADISSON COURT fr Jackson st south wd 9 Map L 10, Zone 3

E Colvin bus

100 Hasbrouck Homer A—1
101 Maloney Edna Mrs—1
102 Henderson Emanuel—2
103 Malley Alf A—2
104 Trotman Laura Mrs—2
105 Gilson Grace Mrs—2
106 Powell Homer W—1
107 DeFore Chas C jr—1
108 Cotton Lillian Mrs—1
109 Pfohl Edw P—1
110 Battles Frances Mrs—2
111 Hamacher Marian Mrs—2
112 Ford Arth M—2
113 Bottrill Sarah Mrs—2
114 Leonard Randolph—1
115 Robb Ruth V Mrs—1
116 **Apartments**
apt A Sharpe Mildred Mrs
B Rivers Florence Mrs
C Shepard Ina Mrs
D Irons Bertha Mrs
E Johnson Chas
F Dixon Clifford jr
117 **Apartments**
apt A Barrella John
B Rurka Anthony
C Pandillo Ralph

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1949

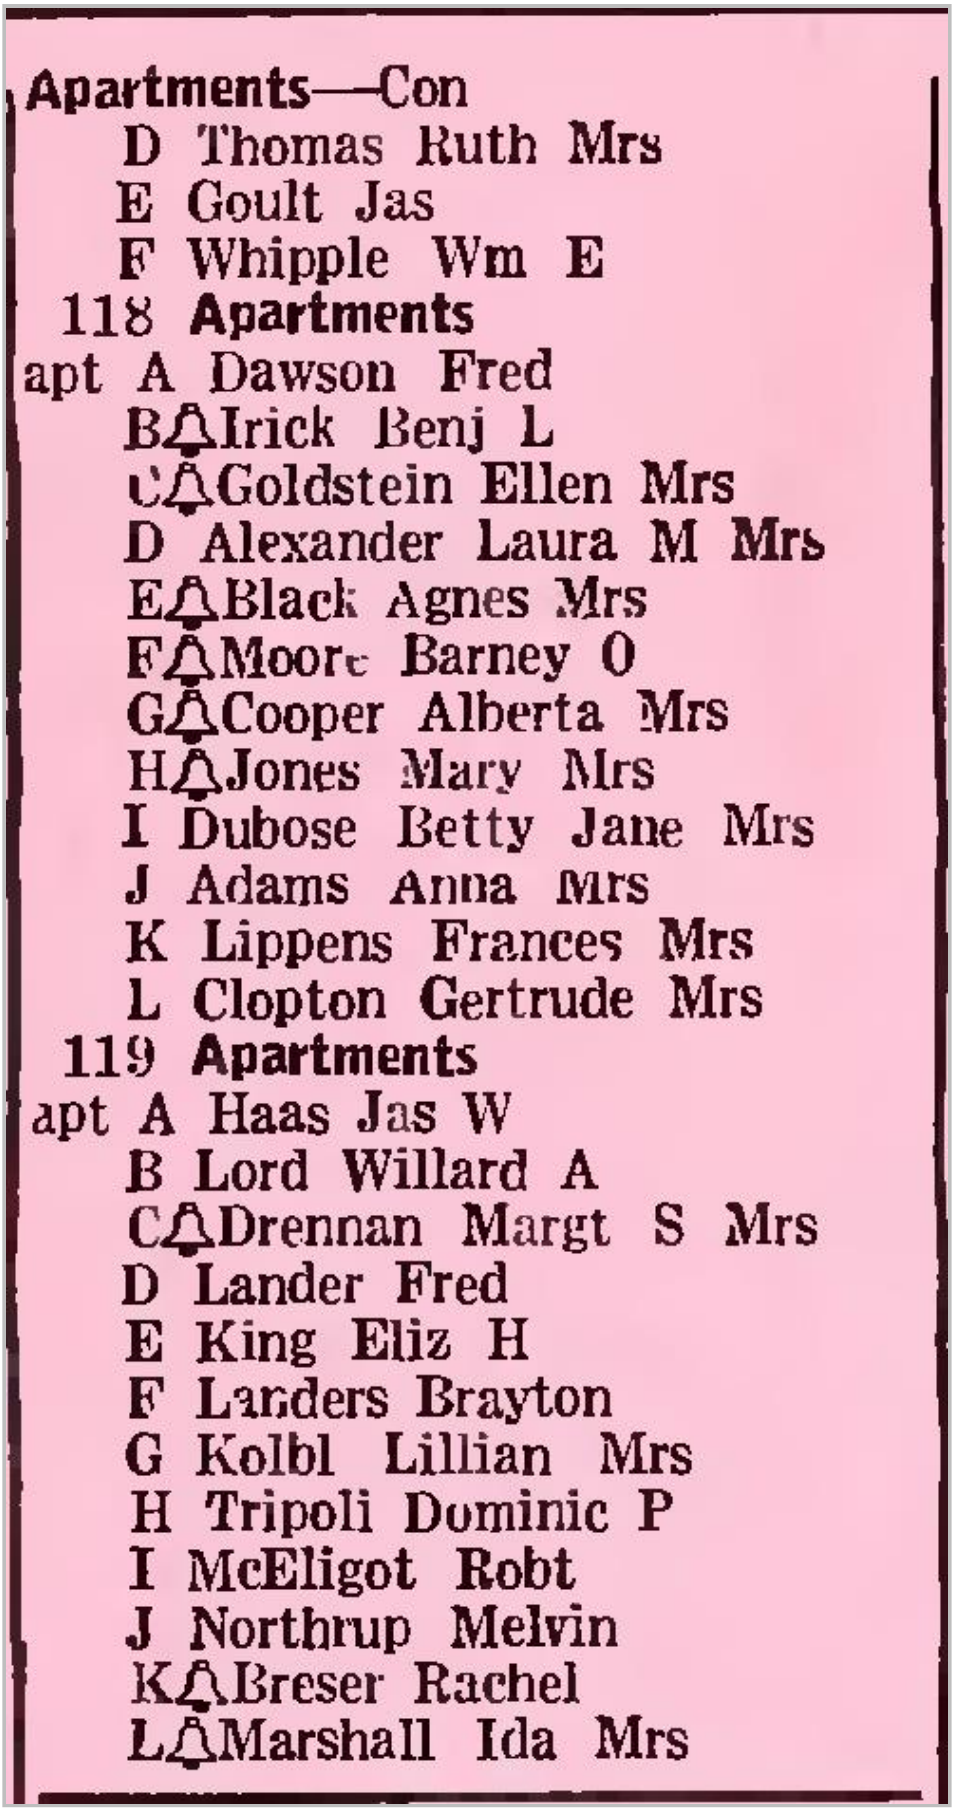

Apartments—Con
D Thomas Ruth Mrs
E Goult Jas
F Whipple Wm E
118 **Apartments**
apt A Dawson Fred
B Irick Benj L
C Goldstein Ellen Mrs
D Alexander Laura M Mrs
E Black Agnes Mrs
F Moore Barney O
G Cooper Alberta Mrs
H Jones Mary Mrs
I Dubose Betty Jane Mrs
J Adams Anna Mrs
K Lippens Frances Mrs
L Clopton Gertrude Mrs
119 **Apartments**
apt A Haas Jas W
B Lord Willard A
C Drennan Margt S Mrs
D Lander Fred
E King Eliz H
F Landers Brayton
G Kolbl Lillian Mrs
H Tripoli Dominic P
I McEligot Robt
J Northrup Melvin
K Breser Rachel
L Marshall Ida Mrs

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1944

EAST TAYLOR STREET fr 901
S Salina east to 400 Renwick av
wds 9, 15, 18 Map L 9-10
S Salina bus to beginning. E Colvin bus to 400

109 Davidson Alf M pntr h—1
Griffin Mary C Mrs—2
111 Vacant
113 McCarthy Fannie Mrs—1 ◎
LaPoint Geo
Rossberg Wm F—2
Montgomery st crosses
201 Barbieri Louis
203 Nappi Jos—2
205 Voutsinas Andrew—1
Irving Robt T—2
207 Kuhn Ida M Mrs ◎
S State st crosses
305 Vacant—1
Penney Shirley E—2
307 Jones Charlotte Mrs
309 Palmer Curtis J
311 Vacant
313 Baker Floyd F
315 Carter Leon
317 Coyle Leviathan J—1
Gardner Chas M—2
319 Barber Lena M Mrs—1
Schmunk Robt—2
Oakwood av begins
321 Wright Tracy B
323 Dority Geo F
325 Vincent Wm
S Townsend st ends
405 to 423 Syracuse Housing Project
Wilson Playground
S McBride st crosses
Gage ct begins
500 Jarvis Harry V
502 Curtis Lena M Mrs
504 Donohue Mary Mrs ◎
506 Miller Koppel ◎
508 Nowek Isadore
510 VanPatten Frank
511 Muehlenhein Wm
512 Shulman Clement pntr h—1 ◎
Schwartzberg Maurice H—2
516 Gates Clifford A
518 Supiro Julius ◎
Weiner Eva Mrs
520 Newer Morris—1
Strait Thos
Gilchrist Fred W—2
Carlson Chas
Almond st crosses
600 Boddy Mary E Mrs—1
Moore Clarence—2
601-615 Syracuse Housing Project
602 Rogoski Leo A—1
Noonan John J
Miller Wm—2
rear Clarke Louise Mrs
604 Vacant store
Zendle Nathan ◎
DePew Etta L Mrs
606 Cohen Jacob ◎
608 Feeney Nora Mrs
610 Vecchiarino Benj—1
Kitter Cath A Mrs—2

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1944

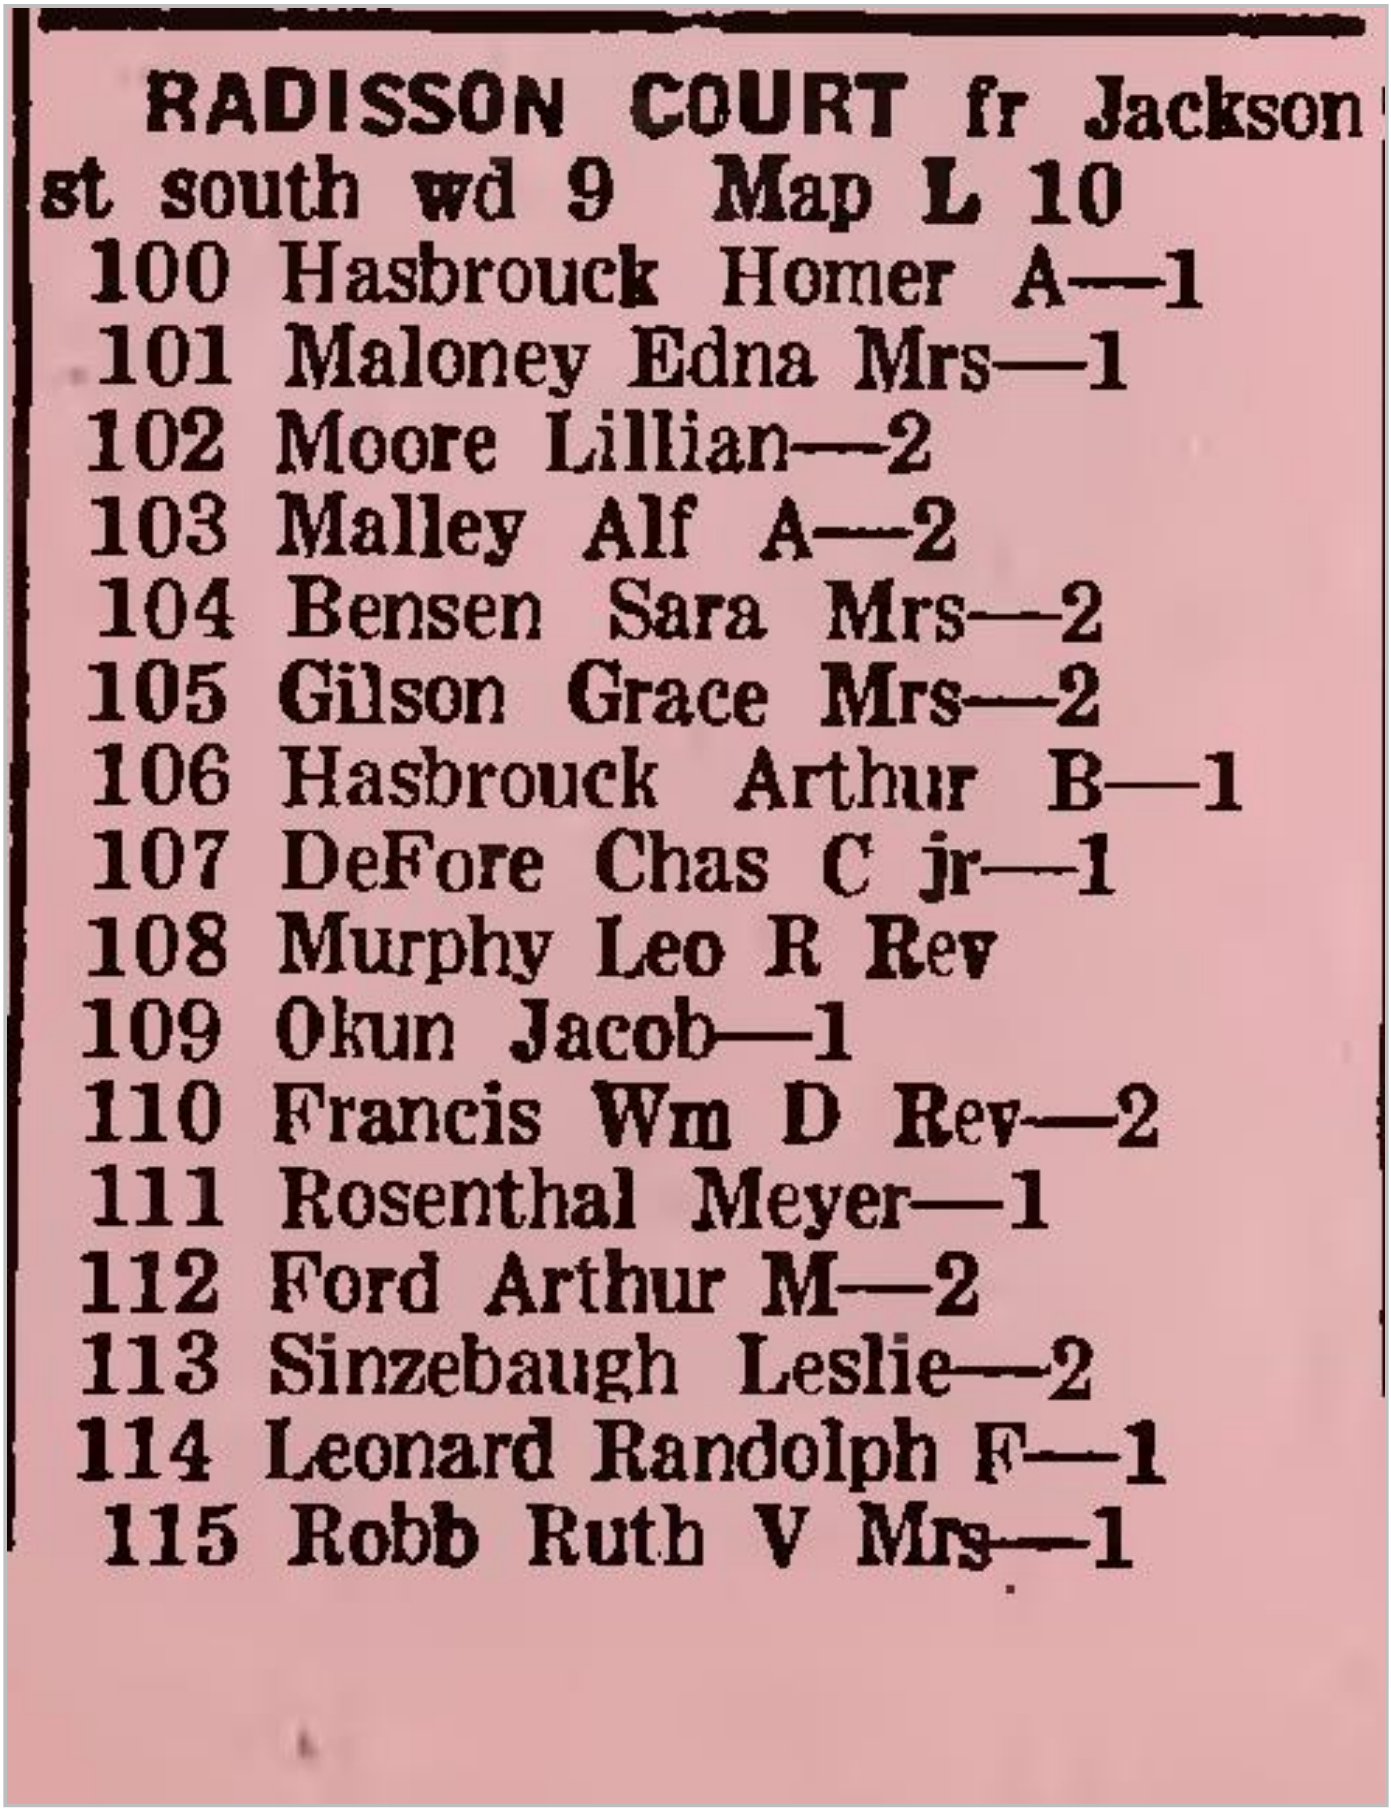

RADISSON COURT fr Jackson
st south wd 9 Map L 10
100 Hasbrouck Homer A—1
101 Maloney Edna Mrs—1
102 Moore Lillian—2
103 Malley Alf A—2
104 Bensen Sara Mrs—2
105 Gilson Grace Mrs—2
106 Hasbrouck Arthur B—1
107 DeFore Chas C jr—1
108 Murphy Leo R Rev
109 Okun Jacob—1
110 Francis Wm D Rev—2
111 Rosenthal Meyer—1
112 Ford Arthur M—2
113 Sinzebaugh Leslie—2
114 Leonard Randolph F—1
115 Robb Ruth V Mrs—1

Target Street	Cross Street	Source
✓	-	Polk's City Directory

RADISSON CT 1944

116 Apartments
apt A Sharpe Mildred Mrs
" B Shepard Arthur
" C Shepherd Ina Mrs
" D Smith Kermet
" E Page Fredk H
" F Dixon Clifford jr
117 Apartments
apt A Uhlig Katherine Mrs
" B Sweet Eug
" C Baranello Carmine
" D Dickson John
" E Sullivan Thos
" F Papajohn Christopher
118 Apartments
apt A Mallory Earl M
" B Irick Benj L
" C Love Roosevelt
" D Alexander Laura M Mrs
" E Black Willard
" F Jordon Alphonso
" G Cooper Alberta Mrs
" H Spence Edw
" I Williams Howard
" J Reel Jas A
" K Lippono Frances Mrs
" L Smith Lillie Mrs
119 Apartments
apt A Garrish Mary Mrs
" B Gale Eug F
" C Hyland Anna F Mrs
" D Stoyan Geo S
" E Donadio Frank
" F Landers Brayton
" G Miller Albert T
" H Vaughn Cecelia Mrs
" I Grant Edw
" J Cousineau Clyde
" K LaVine Etta Mrs
" L Marshall Ida Mrs

Target Street	Cross Street	Source
-	✓	Polk's City Directory

E TAYLOR ST 1939

EAST TAYLOR STREET fr 901 S Salina east to 400 Renwick av wds 9, 15, 18 Map L 9-10
S Salina car to beginning, E Colvin bus to 400

102 Central City Auto Radiator Works
106 Russell Eliz Mrs ◎
107 Hamilton Frank C
Carr Anna E—1
Hayes Marie M Mrs—2
108 Mosher Chas—1
DeBottis Jos L—2
109 Davidson Alf M pntr h—1
Griffin Mary C Mrs—2
111 Brown Louise C Mrs—1
Thompson Chas F—2
113 McCarthy Fannie Mrs—1 ◎
Oakes Alice Mrs—1
LaPointe Geo H—2

Montgomery st crosses

201 Vacant
203 Covell Wm pntr h—2
205 Sylvester Wilfred E—1
Irving Robt T—2
207 Kuhn Ida M Mrs ◎
209 Winslow Robt W

S State st crosses

305 Alexander Lewis—1
Thousand Wm—2
307 Winsor Mildred M Mrs
309 Palmer Curtis J
311 Rogers Agnes B ◎
313 Bagan Anna Mrs
315 Gilbo Wm
317 Dustick Edwd—1
Higgins John P—2
319 Barber Martin—1
Stormes Willard—2

Oakwood av begins

321 Wright Tracy B
323 Wilson Edna M Mrs
Shaffer Alonzo pntr
325 Sprague Percy N

S Townsend st ends

405 to 423 Syracuse Housing Project

S McBride st crosses

500 Burr Abr
502 McGuire Agnes E Mrs
504 Donohue Mary Mrs ◎
506 Miller Koppel ◎
508 Nowek Isadore
Nowek Libbie nurse
510 Patten Frank P
511 Hardy Geo L
512 Shulman Clement pntr h—1 ◎
Schwartzberg Maurice H—2
516 Crooms Jas C
Hurwitz Irving
518 Supiro Julius ◎
Weiner Hyman
520 Hayman Moses—1
Newer Morris
Berger Irving—2
Thieberger Carl M

Almond st crosses

600 Boddy Mary E Mrs—1
Moore Clarence—2
601 Ayers Edwd—2
602 Mankoff Hyman L—1
Mellnick Wm
Miller Wm—2
rear Clarke Louise Mrs
603 Hernandez Thos
604 Vacant store
Zendle Nathan ◎
605 Vacant
606 Cohen Jacob ◎
607 Brizelo Smithy
608 Feeney Frank M
609 Parks Elmer E
rear Vacant
610 Vecchiarino Benj—1
Ritzheimer Geo A—2

East Adams Redevelopment - Phase 6 Area
100 Raddison Court
Syracuse, NY 13202

Inquiry Number: 8026566.7
June 23, 2025

EDR Building Permit Report

Target Property and Adjoining Properties

Environmental Data Resources Inc

6 Armstrong Road
Shelton, CT 06484
800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION

About This Report

Executive Summary

Findings

Glossary

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. **NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT.** Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2023 by Environmental Data Resources, LLC. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, LLC, or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

EDR BUILDING PERMIT REPORT

About This Report

The EDR Building Permit Report provides a practical and efficient method to search building department records for indications of environmental conditions. Generated via a search of municipal building permit records gathered from more than 1,600 cities nationwide, this report will assist you in meeting the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E1527 - 21), or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

Building permit data can be used to identify current and/or former operations and structures/features of environmental concern. The data can provide information on a target property and adjoining properties such as the presence of underground storage tanks, pump islands, sumps, drywells, etc., as well as information regarding water, sewer, natural gas, electrical connection dates, and current/former septic tanks.

Methodology

EDR has developed the EDR Building Permit Report through our partnership with BuildFax, the nation's largest repository of building department records. BuildFax collects, updates, and manages building department records from local municipal governments. The database now includes 30 million permits, on more than 10 million properties across 1,600 cities in the United States.

The EDR Building Permit Report comprises local municipal building permit records, gathered directly from local jurisdictions, including both target property and adjoining properties. Years of coverage vary by municipality. Data reported includes (where available): date of permit, permit type, permit number, status, valuation, contractor company, contractor name, and description.

Incoming permit data is checked at seven stages in a regimented quality control process, from initial data source interview, to data preparation, through final auditing. To ensure the building department is accurate, each of the seven quality control stages contains, on average, 15 additional quality checks, resulting in a process of approximately 105 quality control "touch points."

For more information about the EDR Building Permit Report, please contact your EDR Account Executive at (800) 352-0050.

EDR® Environmental Data Resources Inc

BUILD FAX PROPERTY HISTORY

EXECUTIVE SUMMARY: SEARCH DOCUMENTATION

A search of building department records was conducted by Environmental Data Resources, Inc (EDR) on behalf of Langan on Jun 23, 2025.

TARGET PROPERTY

100 Raddison Court
Syracuse, NY 13202

SEARCH METHODS

EDR searches available lists for both the Target Property and Surrounding Properties.

RESEARCH SUMMARY

Building permits identified: **YES**

The following research sources were consulted in the preparation of this report. An "X" indicates where information was identified in the source and provided in this report.

Syracuse

Year	*Source*	*TP*	*Adjoining*
2025	City of Syracuse, Division of Code Enforcement		X
2024	City of Syracuse, Division of Code Enforcement		X
2023	City of Syracuse, Division of Code Enforcement		X
2022	City of Syracuse, Division of Code Enforcement		X
2021	City of Syracuse, Division of Code Enforcement		X
2020	City of Syracuse, Division of Code Enforcement		X
2019	City of Syracuse, Division of Code Enforcement		X
2018	City of Syracuse, Division of Code Enforcement		X
2017	City of Syracuse, Division of Code Enforcement		X
2016	City of Syracuse, Division of Code Enforcement		X
2015	City of Syracuse, Division of Code Enforcement		X
2014	City of Syracuse, Division of Code Enforcement		X
2013	City of Syracuse, Division of Code Enforcement		X
2012	City of Syracuse, Division of Code Enforcement		X
2011	City of Syracuse, Division of Code Enforcement		X
2010	City of Syracuse, Division of Code Enforcement		X
2009	City of Syracuse, Division of Code Enforcement		X
2008	City of Syracuse, Division of Code Enforcement		X
2007	City of Syracuse, Division of Code Enforcement		X
2006	City of Syracuse, Division of Code Enforcement		X
2005	City of Syracuse, Division of Code Enforcement		X
2004	City of Syracuse, Division of Code Enforcement		X
2003	City of Syracuse, Division of Code Enforcement		X
2002	City of Syracuse, Division of Code Enforcement		X
2001	City of Syracuse, Division of Code Enforcement		X
2000	City of Syracuse, Division of Code Enforcement		X
1999	City of Syracuse, Division of Code Enforcement		X
1998	City of Syracuse, Division of Code Enforcement		

EXECUTIVE SUMMARY: SEARCH DOCUMENTATION

Year	Source	TP	Adjoining
1997	City of Syracuse, Division of Code Enforcement		
1996	City of Syracuse, Division of Code Enforcement		
1995	City of Syracuse, Division of Code Enforcement		
1994	City of Syracuse, Division of Code Enforcement		
1993	City of Syracuse, Division of Code Enforcement		
1992	City of Syracuse, Division of Code Enforcement		
1991	City of Syracuse, Division of Code Enforcement		
1990	City of Syracuse, Division of Code Enforcement		
1989	City of Syracuse, Division of Code Enforcement		
1988	City of Syracuse, Division of Code Enforcement		
1987	City of Syracuse, Division of Code Enforcement		
1986	City of Syracuse, Division of Code Enforcement		
1985	City of Syracuse, Division of Code Enforcement		
1984	City of Syracuse, Division of Code Enforcement		
1983	City of Syracuse, Division of Code Enforcement		
1982	City of Syracuse, Division of Code Enforcement		
1981	City of Syracuse, Division of Code Enforcement		
1980	City of Syracuse, Division of Code Enforcement		
1979	City of Syracuse, Division of Code Enforcement		
1978	City of Syracuse, Division of Code Enforcement		
1977	City of Syracuse, Division of Code Enforcement		
1976	City of Syracuse, Division of Code Enforcement		
1975	City of Syracuse, Division of Code Enforcement		
1974	City of Syracuse, Division of Code Enforcement		
1973	City of Syracuse, Division of Code Enforcement		
1972	City of Syracuse, Division of Code Enforcement		
1971	City of Syracuse, Division of Code Enforcement		
1970	City of Syracuse, Division of Code Enforcement		
1969	City of Syracuse, Division of Code Enforcement		
1968	City of Syracuse, Division of Code Enforcement		
1967	City of Syracuse, Division of Code Enforcement		
1966	City of Syracuse, Division of Code Enforcement		
1965	City of Syracuse, Division of Code Enforcement		
1964	City of Syracuse, Division of Code Enforcement		
1963	City of Syracuse, Division of Code Enforcement		
1962	City of Syracuse, Division of Code Enforcement		
1961	City of Syracuse, Division of Code Enforcement		
1960	City of Syracuse, Division of Code Enforcement		

Name: JurisdictionName
Years: Years
Source: Source
Phone: Phone

BUILDING DEPARTMENT RECORDS SEARCHED

Name: Syracuse
Years: 1960-2025
Source: City of Syracuse, Division of Code Enforcement, SYRACUSE, NY
Phone: (315) 448-8600

Name: Ithaca town
Years: 1955-2019
Source: Town of Ithaca, Building and Code Enforcement Department, BINGHAMTON, NY
Phone: (607) 273-1783

Name: De Witt town
Years: 1974-2015
Source: , SYRACUSE, NY
Phone: (315) 446-3910

TARGET PROPERTY FINDINGS

TARGET PROPERTY DETAIL

100 Raddison Court
Syracuse, NY 13202

No Permits Found

ADJOINING PROPERTY FINDINGS

ADJOINING PROPERTY DETAIL

The following Adjoining Property addresses were researched for this report. Detailed findings are provided for each address.

BURT ST

407 BURT ST

Date:	**12/30/2010**
Permit Type:	**RESIDENTIAL**
Description:	**DEMO ONE STORY WOOD FRAME SINGLE FAMILY PER THE ATTACHED APPROVALS.**
Permit Description:	**DEMOLTION**
Work Class:	
Proposed Use:	
Permit Number:	99995
Status:	
Valuation:	$6,000.00
Contractor Company:	
Contractor Name:	

Date:	**1/28/2009**
Permit Type:	**RESIDENTIAL**
Description:	
Permit Description:	**HEATING**
Work Class:	
Proposed Use:	
Permit Number:	91333
Status:	
Valuation:	$1,800.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

409 BURT ST

Date:	**2/26/2019**
Permit Type:	
Description:	**Demolish a storage building**
Permit Description:	**Demolition**
Work Class:	
Proposed Use:	
Permit Number:	36926
Status:	
Valuation:	$1,800.00
Contractor Company:	
Contractor Name:	Diversified Construction Services

Date:	**10/9/2018**
Permit Type:	
Description:	**Electric for new pole service.**
Permit Description:	**Electric**
Work Class:	
Proposed Use:	
Permit Number:	35571
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Syr Housing Authority

Date:	**3/28/2003**
Permit Type:	**COMMERCIAL**
Description:	
Permit Description:	**INTRUSION ALARM SYSTEM**
Work Class:	
Proposed Use:	
Permit Number:	61246
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

410 BURT ST

Date:	**12/9/1999**
Permit Type:	**RESIDENTIAL**
Description:	**DEMOLISH 1 FAMILY STRUCTURE**
Permit Description:	**DEMOLTION**
Work Class:	
Proposed Use:	
Permit Number:	43031
Status:	
Valuation:	$5,000.00
Contractor Company:	
Contractor Name:	

412 BURT ST

Date:	**12/9/1999**
Permit Type:	**RESIDENTIAL**
Description:	**DEMOLISH 1 FAMILY STRUCTURE**
Permit Description:	**DEMOLTION**
Work Class:	
Proposed Use:	
Permit Number:	43030
Status:	
Valuation:	$500.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

414 BURT ST

Date:	**10/15/2007**
Permit Type:	**RESIDENTIAL**
Description:	**DEMO ONE FAMILY PER THE ATTACHED APPROVALS.**
Permit Description:	**DEMOLTION**
Work Class:	
Proposed Use:	
Permit Number:	85179
Status:	
Valuation:	$6,000.00
Contractor Company:	
Contractor Name:	

418 BURT ST

Date:	**7/19/2002**
Permit Type:	**RESIDENTIAL**
Description:	**DEMO 2 FAM WOOD STRUCTURE**
Permit Description:	**DEMOLTION**
Work Class:	
Proposed Use:	
Permit Number:	57755
Status:	
Valuation:	$3,000.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

450 BURT ST

Date: **6/27/2019**
Permit Type:
Description: **Kitchen Hood - Freedom Commons**

Permit Description: **HVAC/Mechanical**
Work Class:
Proposed Use:
Permit Number: 38331
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Freedom Commons Housing

Date: **5/9/2018**
Permit Type:
Description: **Fire alarms for Freedom Commons**

Permit Description: **Fire Alarm**
Work Class:
Proposed Use:
Permit Number: 30897
Status:
Valuation: $0.00
Contractor Company:
Contractor Name:

Date: **5/7/2018**
Permit Type:
Description: **Sprinkler**

Permit Description: **Sprinkler**
Work Class:
Proposed Use:
Permit Number: 33235
Status:
Valuation: $1,500.00
Contractor Company:
Contractor Name: Freedom Commons Housing

ADJOINING PROPERTY FINDINGS

Date: **3/26/2018**
Permit Type:
Description: **Install new elevator**

Permit Description: **Elevator**
Work Class:
Proposed Use:
Permit Number: 31130
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Freedom Commons Housing

Date: **1/18/2018**
Permit Type:
Description: **Electric**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 31196
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Hoefler Communications Inc

Date: **1/11/2018**
Permit Type:
Description: **HVAC for Freedom Commons**

Permit Description: **HVAC/Mechanical**
Work Class:
Proposed Use:
Permit Number: 31131
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Freedom Commons Housing

ADJOINING PROPERTY FINDINGS

Date: **10/25/2017**
Permit Type:
Description: **HVAC for Freedom Commons**

Permit Description: **Sprinkler**
Work Class:
Proposed Use:
Permit Number: 30484
Status:
Valuation: $35,000.00
Contractor Company:
Contractor Name: Freedom Commons Housing

Date: **5/24/2017**
Permit Type:
Description: **Site Work**

Permit Description: **Site Work**
Work Class:
Proposed Use:
Permit Number: 27575
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse Housing Authority

Date: **5/24/2017**
Permit Type:
Description: **Erect New Building.****TCO typed, awaiting signatures 7/8/2019****C of O typed, awaiting signatures 7/19/2019***C of O issued 7/22/2019**

Permit Description: **Com. New Building**
Work Class:
Proposed Use:
Permit Number: 27576
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Norstar Building Corp

ADJOINING PROPERTY FINDINGS

Date: **5/24/2017**
Permit Type:
Description: **Electric**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 28445
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Freedom Commons Housing c/o Syracuse Housing Authority

E TAYLOR ST

301 E TAYLOR ST

Date: **9/10/2002**
Permit Type: **RESIDENTIAL**
Description: **MC KINNEY MANOR- 119 ANGELOU TERR.**

Permit Description: **ELECTRICAL**
Work Class:
Proposed Use:
Permit Number: 58625
Status:
Valuation: $1,000.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

500 E TAYLOR ST

Date:	**1/15/2025**
Permit Type:	
Description:	**Construct building for vehicle and equipement storage**
Permit Description:	**Com. New Building**
Work Class:	
Proposed Use:	
Permit Number:	51146
Status:	
Valuation:	$900.00
Contractor Company:	
Contractor Name:	Parsons and McKenna

Date:	**9/3/2024**
Permit Type:	
Description:	**Replace VFD and motor for ID Fan #3**
Permit Description:	**Electrical**
Work Class:	
Proposed Use:	
Permit Number:	ELECTRIC-2024-847
Status:	Approved
Valuation:	$80,000.00
Contractor Company:	
Contractor Name:	

Date:	**6/12/2024**
Permit Type:	
Description:	**Install Lighting, Devices and Data in New Office Spaces**
Permit Description:	**Electrical**
Work Class:	
Proposed Use:	
Permit Number:	ELECTRIC-2024-523
Status:	Finaled
Valuation:	$90,220.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

Date:	**6/11/2024**
Permit Type:	
Description:	**Renovate 325 sq ft office space ****CO TYPED-AWAITING SIGNATURES 10/7/2024CO ISSUED 11/25/2024**
Permit Description:	**Com. Reno/Rem/Chg Occ**
Work Class:	
Proposed Use:	
Permit Number:	50009
Status:	
Valuation:	$2,500.00
Contractor Company:	
Contractor Name:	Syracuse University

Date:	**4/12/2024**
Permit Type:	
Description:	**New Building**
Permit Description:	**Com. New Building**
Work Class:	
Proposed Use:	
Permit Number:	503744
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Bond Building Construction Inc.

Date:	**4/5/2024**
Permit Type:	
Description:	**New Building**
Permit Description:	**Com. New Building**
Work Class:	
Proposed Use:	
Permit Number:	50374
Status:	
Valuation:	$12,100.00
Contractor Company:	
Contractor Name:	Bond Building Construction Inc.

ADJOINING PROPERTY FINDINGS

Date:	**3/21/2024**
Permit Type:	
Description:	**Replace emergency lights, demo abandoned conduit**
Permit Description:	**Electrical**
Work Class:	
Proposed Use:	
Permit Number:	ELECTRIC-2024-239
Status:	Approved
Valuation:	$2,000.00
Contractor Company:	
Contractor Name:	

Date:	**1/2/2024**
Permit Type:	
Description:	**Footing and Foundation - SU STEAM**
Permit Description:	**Footing / Foundation**
Work Class:	
Proposed Use:	
Permit Number:	50002
Status:	
Valuation:	$18,000.00
Contractor Company:	
Contractor Name:	Bond Building Construction Inc.

Date:	**12/19/2023**
Permit Type:	
Description:	**electrical service, power, lights, data, fire alarm, security, communications etc....**
Permit Description:	**Electrical**
Work Class:	
Proposed Use:	
Permit Number:	ELECTRIC-2023-1189
Status:	Approved
Valuation:	$10.50
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

Date:	**12/5/2023**
Permit Type:	
Description:	**Site Work - Steam Plant**
Permit Description:	**Site Work**
Work Class:	
Proposed Use:	
Permit Number:	49806
Status:	
Valuation:	$50.00
Contractor Company:	
Contractor Name:	Bond Building Construction Inc.

Date:	**10/23/2023**
Permit Type:	
Description:	**Select electrical demo & temporary power**
Permit Description:	**Electrical**
Work Class:	
Proposed Use:	
Permit Number:	ELECTRIC-2023-1012
Status:	Approved
Valuation:	$50,000.00
Contractor Company:	
Contractor Name:	

Date:	**6/1/2022**
Permit Type:	
Description:	**Upgrade to life safety event reporting system panel.**
Permit Description:	**Electrical**
Work Class:	
Proposed Use:	
Permit Number:	ELECTRIC-2022-521
Status:	Approved
Valuation:	$10,000.00
Contractor Company:	
Contractor Name:	David Maher

ADJOINING PROPERTY FINDINGS

Date: **3/8/2022**
Permit Type:
Description: **SEC Riley Plant Deaerator Upgrade**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 45671
Status:
Valuation: $400.00
Contractor Company:
Contractor Name: Industrial Contracting Inc.

Date: **2/3/2022**
Permit Type:
Description:

Permit Description: **Electrical**
Work Class:
Proposed Use:
Permit Number: ELECTRIC-2022-28
Status: Approved
Valuation: $120,000.00
Contractor Company:
Contractor Name: Kaitlynne Knapp

Date: **4/22/2021**
Permit Type:
Description:

Permit Description: **Electrical**
Work Class:
Proposed Use:
Permit Number: SUBMISSION-2021-521
Status: Approved
Valuation: $43,000.00
Contractor Company:
Contractor Name: Kaitlynne Knapp

ADJOINING PROPERTY FINDINGS

Date: **3/17/2021**
Permit Type:
Description:

Permit Description: **Electrical**
Work Class:
Proposed Use:
Permit Number: SUBMISSION-2021-334
Status: Approved
Valuation: $7,850.00
Contractor Company:
Contractor Name: Joseph Cardinal

Date: **12/3/2019**
Permit Type:
Description: **Electric: Steam and Chilled Water**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 40266
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse University

Date: **11/6/2019**
Permit Type:
Description: **Modifications to the steam plant's neutralization system & upgrades of equipment**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 39616
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: MRL Constructors of New York Inc

ADJOINING PROPERTY FINDINGS

Date:	**11/4/2019**
Permit Type:	
Description:	**Modifications to the steam plant's neutralization system & upgrades of equipment including the removal of the mezzanine.**
Permit Description:	**Com. Reno/Rem/Chg Occ**
Work Class:	
Proposed Use:	
Permit Number:	39617
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Industrial Contracting Inc.

Date:	**9/16/2019**
Permit Type:	
Description:	**Electric: units 201 and 202, Steam and Chilled Water**
Permit Description:	**Electric**
Work Class:	
Proposed Use:	
Permit Number:	39386
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Syracuse University

Date:	**9/4/2019**
Permit Type:	
Description:	**HVAC: Steam and Chilled Water**
Permit Description:	**HVAC/Mechanical**
Work Class:	
Proposed Use:	
Permit Number:	39246
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Syracuse University

ADJOINING PROPERTY FINDINGS

Date: **5/16/2019**
Permit Type:
Description: **Electric: Steam and Chilled Water**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 37980
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse University

Date: **4/15/2019**
Permit Type:
Description: **Electric**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 37606
Status:
Valuation: $8,000.00
Contractor Company:
Contractor Name:

Date: **2/22/2019**
Permit Type:
Description: **Tank Removal: Remove (1) 275 US Gallon above ground fuel oil tank.Department of Environmental Conservation - Spill Number: 1810736**

Permit Description: **FPB Tank - Removal**
Work Class:
Proposed Use:
Permit Number: 36849
Status:
Valuation: $0.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date: **5/15/2018**
Permit Type:
Description: **electric - 2nd flr steam station**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 33305
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse University

Date: **11/20/2017**
Permit Type:
Description: **Low voltage for 2nd floor**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 30761
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse University

Date: **10/25/2017**
Permit Type:
Description: **Electric - Low Voltage for Steam and Chilled Water**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 30526
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse University

ADJOINING PROPERTY FINDINGS

Date: **5/17/2017**
Permit Type:
Description: **Fire alarms for Alco & Riley building**

Permit Description: **Fire Alarm**
Work Class:
Proposed Use:
Permit Number: 28074
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse University

Date: **5/1/2017**
Permit Type:
Description: **electric**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 28328
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: O'Connell Electric

Date: **4/6/2017**
Permit Type:
Description: **Replace flat roof and structural modifications**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 27789
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse University

ADJOINING PROPERTY FINDINGS

Date: **6/6/2016**
Permit Type:
Description: **Generator Docking Station & Additional Lighting Upgrades.**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 24214
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse University

Date: **12/2/2015**
Permit Type:
Description: **Electrical**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 22108
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse University

Date: **11/30/2015**
Permit Type:
Description: **Low Voltage**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 21914
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse University

ADJOINING PROPERTY FINDINGS

Date: **8/27/2015**
Permit Type:
Description: **Electrical**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 20680
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse University

Date: **3/25/2015**
Permit Type:
Description: **elec**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 18648
Status:
Valuation: $0.00
Contractor Company:
Contractor Name:

Date: **8/5/2014**
Permit Type:
Description: **Electrical for Steam Station**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 16104
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse University

ADJOINING PROPERTY FINDINGS

Date:	**6/2/2014**
Permit Type:	
Description:	**HVAC-Steam station second floor offices**
Permit Description:	**HVAC/Mechanical**
Work Class:	
Proposed Use:	
Permit Number:	14398
Status:	
Valuation:	$199,655.00
Contractor Company:	
Contractor Name:	Syracuse University

Date:	**6/2/2014**
Permit Type:	
Description:	**Instrumentation Upgrade for Riley Steam Station Pressure Reduction.EMERALD ELECTRIC CONTRACTORS (14123)**
Permit Description:	**Electric**
Work Class:	
Proposed Use:	
Permit Number:	15421
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Emerald Electrical Contractors

Date:	**5/30/2014**
Permit Type:	
Description:	**Install a panelized office system with mezzanine above on 2nd floor of Steam Station**
Permit Description:	**Com. Reno/Rem/Chg Occ**
Work Class:	
Proposed Use:	
Permit Number:	14975
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Syracuse University

ADJOINING PROPERTY FINDINGS

Date: **5/30/2014**
Permit Type:
Description: **Exterior alterations related to the installation of a high-pressure gas line.**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 15029
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syracuse University

Date: **11/8/2013**
Permit Type:
Description: **RILEY BUILDING @ SU STEAM STATION: - FOUR EYE WASH AND SHOWER STATIONS WITH ASSOCIATED DETECTION AND ALARM ANNUNCIATIONALLIED ELECTRIC**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 13327
Status:
Valuation: $20,320.00
Contractor Company:
Contractor Name: Syracuse University

Date: **7/16/2013**
Permit Type:
Description: **Sprinkler work for S. U. Steamed Station**

Permit Description: **Sprinkler**
Work Class:
Proposed Use:
Permit Number: 11896
Status:
Valuation: $725.00
Contractor Company:
Contractor Name: Syracuse University

ADJOINING PROPERTY FINDINGS

Date:	**9/26/2012**
Permit Type:	
Description:	**Erect a 14' X 14' addition to the north west corner of the building type VB construction for type U occupancy as per attached plans dated 4-20-12 for water tank enclosure. Separate permits are required for Electrical & plaumbing.A FINAL REPORT MUST BE SUBMITTED INDICATING THAT ALL SPECIAL INSPECTIONS HAVE BEEN MADE, AND ALL DISCREPANCIES HAVE BEEN RESOLVED PRIOR TO ISSUANCE OF A C/C**
Permit Description:	**Com. Reno/Rem/Chg Occ**
Work Class:	
Proposed Use:	
Permit Number:	08551
Status:	
Valuation:	$23,000.00
Contractor Company:	
Contractor Name:	Syracuse University

Date:	**9/21/2012**
Permit Type:	
Description:	**Electrical work for outside diesel tanks and inside storage shed.AHR Mechanical**
Permit Description:	**Electric**
Work Class:	
Proposed Use:	
Permit Number:	08467
Status:	
Valuation:	$2,720.00
Contractor Company:	
Contractor Name:	Syracuse University

ADJOINING PROPERTY FINDINGS

Date:	**8/7/2012**
Permit Type:	
Description:	**Low voltage work for Control Room at Steam PlantSU Technicians**
Permit Description:	**Electric**
Work Class:	
Proposed Use:	
Permit Number:	07865
Status:	
Valuation:	$10,879.00
Contractor Company:	
Contractor Name:	Syracuse University

Date:	**8/1/2012**
Permit Type:	
Description:	**Erect a 14' X 14' addition to the north west corner of the building, type VB construction, for type U occupancy as per attached plans dated 4/20/12 for water tank enclosure. Separate permits are required for plumbing, and electrical.A final report must be submitted stating that all special inspections have been made and all discrepencies resolved prior to the issuance of a C of C.**
Permit Description:	**Com. Reno/Rem/Chg Occ**
Work Class:	
Proposed Use:	
Permit Number:	07389
Status:	
Valuation:	$23,000.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

Date: **4/6/2012**
Permit Type:
Description: **CHILLED WATER PLANT**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 05848
Status:
Valuation: $15,000.00
Contractor Company:
Contractor Name: Syracuse University

Date: **1/25/2011**
Permit Type: **COMMERCIAL**
Description: **DEMOLITION OF STEEL/MASONARY COMMERCIAL BUILDINGS PER THE ATTACHED PLAN AND REVIEW ON FILE. THE FOLLOWING TO BE**

Permit Description: **DEMOLTION**
Work Class:
Proposed Use:
Permit Number: 210
Status:
Valuation: $400,000.00
Contractor Company:
Contractor Name:

Date: **9/16/2010**
Permit Type: **COMMERCIAL**
Description: **STEAM STATION-RILEY PLANT GRD FLR**

Permit Description: **ELECTRICAL**
Work Class:
Proposed Use:
Permit Number: 98741
Status:
Valuation: $11,850.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date: **12/9/2008**
Permit Type: **COMMERCIAL**
Description: **CHILLED WATER PLANT**

Permit Description: **ELECTRICAL**
Work Class:
Proposed Use:
Permit Number: 90817
Status:
Valuation: $145,000.00
Contractor Company:
Contractor Name:

Date: **12/5/2008**
Permit Type: **COMMERCIAL**
Description: **INSTALL 2 COOLING TOWERS #5 AND #6, RIGGING, RAILING, WALKWAYS, AND RAMPS PER THE ATTACHED PLANS DATED 8/5/08. A**

Permit Description: **MISCELLANEOUS**
Work Class:
Proposed Use:
Permit Number: 90045
Status:
Valuation: $259,000.00
Contractor Company:
Contractor Name:

Date: **10/24/2008**
Permit Type: **COMMERCIAL**
Description: **CHILLED WATER PLANT** **TOWERS 5 & 6**

Permit Description: **HEATING**
Work Class:
Proposed Use:
Permit Number: 90291
Status:
Valuation: $240,000.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date: **7/31/2007**
Permit Type: **COMMERCIAL**
Description: **RILEY BUILDING**

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 84101
Status:
Valuation: $1,300.00
Contractor Company:
Contractor Name:

Date: **7/31/2007**
Permit Type: **COMMERCIAL**
Description: **SU STEAM STATION**

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 84102
Status:
Valuation: $1,950.00
Contractor Company:
Contractor Name:

Date: **12/12/2006**
Permit Type: **COMMERCIAL**
Description: **SU STEAM STATION**

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 81065
Status:
Valuation: $835.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date: **12/12/2006**
Permit Type: **COMMERCIAL**
Description: **SU STEAM STATION-RILEY BUILDING**

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 81066
Status:
Valuation: $1,680.00
Contractor Company:
Contractor Name:

Date: **11/28/2006**
Permit Type: **COMMERCIAL**
Description:

Permit Description: **ELECTRICAL**
Work Class:
Proposed Use:
Permit Number: 80970
Status:
Valuation: $24,600.00
Contractor Company:
Contractor Name:

Date: **9/27/2006**
Permit Type: **COMMERCIAL**
Description: **CHILLED WATER BUILDING**

Permit Description: **HEATING**
Work Class:
Proposed Use:
Permit Number: 80259
Status:
Valuation: $120,000.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date:	**6/7/2005**
Permit Type:	**COMMERCIAL**
Description:	**SU STEAM STATION**
Permit Description:	**ELECTRICAL**
Work Class:	
Proposed Use:	
Permit Number:	72153
Status:	
Valuation:	$7,000.00
Contractor Company:	
Contractor Name:	

Date:	**5/31/2005**
Permit Type:	**COMMERCIAL**
Description:	**INITIAL ENTRY: CONSTRUCT EXTERIOR STAIRWAY PER THE ATTACHED PLAN. (PLAN REVISION #3) SU CHILLED WATER PLANT**
Permit Description:	**REMODELING**
Work Class:	
Proposed Use:	
Permit Number:	71488
Status:	
Valuation:	$124,000.00
Contractor Company:	
Contractor Name:	

Date:	**3/23/2005**
Permit Type:	**COMMERCIAL**
Description:	**CHILLED WATER PLANT**
Permit Description:	**HEATING**
Work Class:	
Proposed Use:	
Permit Number:	70983
Status:	
Valuation:	$4,640.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

Date: **3/15/2005**
Permit Type: **COMMERCIAL**
Description: **FOR CHILLED WATER PLANT**

Permit Description: **ELECTRICAL**
Work Class:
Proposed Use:
Permit Number: 70905
Status:
Valuation: $58,548.00
Contractor Company:
Contractor Name:

Date: **4/30/2004**
Permit Type: **COMMERCIAL**
Description:

Permit Description: **ELECTRICAL**
Work Class:
Proposed Use:
Permit Number: 66882
Status:
Valuation: $9,280.00
Contractor Company:
Contractor Name:

Date: **3/16/2004**
Permit Type: **COMMERCIAL**
Description: **OTHER - VARIABLE FREQ DR.**

Permit Description: **ELECTRICAL**
Work Class:
Proposed Use:
Permit Number: 66317
Status:
Valuation: $10,500.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date: **10/24/2002**
Permit Type: **COMMERCIAL**
Description: **STEAM STATION**

Permit Description: **ELECTRICAL**
Work Class:
Proposed Use:
Permit Number: 59419
Status:
Valuation: $5,000.00
Contractor Company:
Contractor Name:

Date: **9/23/2002**
Permit Type: **COMMERCIAL**
Description: **CHILLED WATER PLANT**

Permit Description: **ELECTRICAL**
Work Class:
Proposed Use:
Permit Number: 58856
Status:
Valuation: $142,500.00
Contractor Company:
Contractor Name:

Date: **9/23/2002**
Permit Type: **COMMERCIAL**
Description: **CHILLED WATER PLANT**

Permit Description: **SMOKE DETECTION SYSTEM**
Work Class:
Proposed Use:
Permit Number: 58857
Status:
Valuation: $21,500.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date: **9/18/2002**
Permit Type: **COMMERCIAL**
Description: **CONSTRUCT NEW CHILLER PLANT ADDITION, ONE STORY 26'X 62' WITH BASEMENT LEVEL FOR FUTURE COOLING TOWERS. ALSO CONST.**

Permit Description: **REMODELING**
Work Class:
Proposed Use:
Permit Number: 57718
Status:
Valuation: $831,000.00
Contractor Company:
Contractor Name:

Date: **9/18/2002**
Permit Type: **COMMERCIAL**
Description: **SYRACUSE UNIVERSITY CHILLED WATER PLANT.**

Permit Description: **HEATING**
Work Class:
Proposed Use:
Permit Number: 57842
Status:
Valuation: $655,000.00
Contractor Company:
Contractor Name:

Date: **9/6/2002**
Permit Type: **COMMERCIAL**
Description: **SU STEAM PLANT**

Permit Description: **HEATING**
Work Class:
Proposed Use:
Permit Number: 58604
Status:
Valuation: $47,299.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date:	**3/29/2001**
Permit Type:	**COMMERCIAL**
Description:	**OTHER ITEMS: CONNECTION FOR GENERATOR SWITCHES** **225A TRANSFER**
Permit Description:	**ELECTRICAL**
Work Class:	
Proposed Use:	
Permit Number:	50326
Status:	
Valuation:	$15,000.00
Contractor Company:	
Contractor Name:	

Date:	**4/28/2000**
Permit Type:	**COMMERCIAL**
Description:	**SU UNDERGROUND STEAM DISTRIBUTION**
Permit Description:	**HEATING**
Work Class:	
Proposed Use:	
Permit Number:	45333
Status:	
Valuation:	$334,000.00
Contractor Company:	
Contractor Name:	

Date:	**4/26/2000**
Permit Type:	**COMMERCIAL**
Description:	**PROJECT ORANGE CO GEN PLANT TRANSFORMER #5**
Permit Description:	**SPRINKLER**
Work Class:	
Proposed Use:	
Permit Number:	44416
Status:	
Valuation:	$765.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

Date: **2/9/2000**
Permit Type: **COMMERCIAL**
Description: **CO GEN PLANT**

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 43766
Status:
Valuation: $275.00
Contractor Company:
Contractor Name:

Date: **1/27/2000**
Permit Type: **COMMERCIAL**
Description: **SU CO GEN PLANT**

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 43752
Status:
Valuation: $150.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

OAKWOOD AVE

116 OAKWOOD AVE

Date:	**9/4/2008**
Permit Type:	**COMMERCIAL**
Description:	**SECURITY TRANSFER FOR HUB LIQUORS**
Permit Description:	**INTRUSION ALARM SYSTEM**
Work Class:	
Proposed Use:	
Permit Number:	89518
Status:	
Valuation:	$49.00
Contractor Company:	
Contractor Name:	

Date:	**5/31/2006**
Permit Type:	**COMMERCIAL**
Description:	
Permit Description:	**INTRUSION ALARM SYSTEM**
Work Class:	
Proposed Use:	
Permit Number:	76551
Status:	
Valuation:	$275.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

140 OAKWOOD AVE

Date: **3/3/2014**
Permit Type:
Description: **Electrical**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 14281
Status:
Valuation: $500.00
Contractor Company:
Contractor Name:

Date: **2/19/2013**
Permit Type:
Description:

Permit Description: **Security Alarm**
Work Class:
Proposed Use:
Permit Number: 10220
Status:
Valuation: $186.00
Contractor Company:
Contractor Name:

Date: **8/24/2012**
Permit Type:
Description: **SMARTWATT LIGHTING PROGRAM.**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 08191
Status:
Valuation: $434.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date: **3/4/2008**
Permit Type: **COMMERCIAL**
Description: **RECONSTRUCT/REPAIR DOOR AND BUILDING FACADE DUE TO DAMAGE FROM AUTOMOBILE ACCIDENT PER THE ATTACHED DRAWING.**

Permit Description: **REMODELING**
Work Class:
Proposed Use:
Permit Number: 86630
Status:
Valuation: $2,000.00
Contractor Company:
Contractor Name:

Date: **7/28/2004**
Permit Type: **COMMERCIAL**
Description: **M&M MARKET**

Permit Description: **SPRINKLER**
Work Class:
Proposed Use:
Permit Number: 63708
Status:
Valuation: $1,395.00
Contractor Company:
Contractor Name:

Date: **3/7/2002**
Permit Type: **COMMERCIAL**
Description:

Permit Description: **INTRUSION ALARM SYSTEM**
Work Class:
Proposed Use:
Permit Number: 55328
Status:
Valuation: $0.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

S MCBRIDE ST

1101 S MCBRIDE ST

Date:	**1/23/2006**
Permit Type:	**COMMERCIAL**
Description:	**INSTALL 1 GENERAL PURPOSE HYDRAULIC PASSENGER ELEVATOR RATED AT 2500 LBS PER ATTACHED PLAN & REVIEW ON FILE.**
Permit Description:	**ELEVATOR**
Work Class:	
Proposed Use:	
Permit Number:	74958
Status:	
Valuation:	$43,100.00
Contractor Company:	
Contractor Name:	

Date:	**11/7/2005**
Permit Type:	**COMMERCIAL**
Description:	**WILSON REC CENTER**
Permit Description:	**ELECTRICAL**
Work Class:	
Proposed Use:	
Permit Number:	74231
Status:	
Valuation:	$57,000.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

Date:	**10/6/2005**
Permit Type:	**COMMERCIAL**
Description:	**INITIAL ENTRY: CONSTRUCT BUILDING EXPANSION PER THE PLANS AND APPROVALS. WILSON PARK COMMUNITY CENTER** **ATTACHED**
Permit Description:	**REMODELING**
Work Class:	
Proposed Use:	
Permit Number:	73319
Status:	
Valuation:	$302,200.00
Contractor Company:	
Contractor Name:	

Date:	**10/5/2005**
Permit Type:	**COMMERCIAL**
Description:	**WILSON REC CENTER**
Permit Description:	**HEATING**
Work Class:	
Proposed Use:	
Permit Number:	71752
Status:	
Valuation:	$100,000.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

1202 S MCBRIDE ST

Date:	**11/15/2010**
Permit Type:	**COMMERCIAL**
Description:	**FOR ALCO BOILER HOUSE**
Permit Description:	**ELECTRICAL**
Work Class:	
Proposed Use:	
Permit Number:	99583
Status:	
Valuation:	$51,000.00
Contractor Company:	
Contractor Name:	

Date:	**7/31/2007**
Permit Type:	**COMMERCIAL**
Description:	**ALCO BUILDING**
Permit Description:	**SPRINKLER**
Work Class:	
Proposed Use:	
Permit Number:	84103
Status:	
Valuation:	$1,950.00
Contractor Company:	
Contractor Name:	

Date:	**12/12/2006**
Permit Type:	**COMMERCIAL**
Description:	**ALCO BUILDING**
Permit Description:	**SPRINKLER**
Work Class:	
Proposed Use:	
Permit Number:	81067
Status:	
Valuation:	$1,300.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

1226 S MCBRIDE ST

Date:	**10/8/2009**
Permit Type:	**COMMERCIAL**
Description:	**DEMO OF A 1 STORY MASONARY STRUCTURE AND A 1 STORY WOOD FRAME STRUCTURE PER THE ATTACHED APPROVALS.**
Permit Description:	**DEMOLTION**
Work Class:	
Proposed Use:	
Permit Number:	94293
Status:	
Valuation:	$29,750.00
Contractor Company:	
Contractor Name:	

Date:	**5/25/2001**
Permit Type:	**COMMERCIAL**
Description:	**800A 1M SERVICE ESO# 413-334**
Permit Description:	**ELECTRICAL**
Work Class:	
Proposed Use:	
Permit Number:	51499
Status:	
Valuation:	$800.00
Contractor Company:	
Contractor Name:	

ADJOINING PROPERTY FINDINGS

900 S MCBRIDE ST

Date: **8/31/2020**
Permit Type:
Description: **Fire Alarm - Northside Women's Wellness Center**

Permit Description: **Fire Alarm**
Work Class:
Proposed Use:
Permit Number: 42262
Status:
Valuation: $70.00
Contractor Company:
Contractor Name: Salina Crossing Housing Dev/Housing Visions

Date: **8/18/2020**
Permit Type:
Description: **Sprinkler - Northside Women's Wellness Center**

Permit Description: **Sprinkler**
Work Class:
Proposed Use:
Permit Number: 42302
Status:
Valuation: $35,000.00
Contractor Company:
Contractor Name: Salina Crossing Housing Dev

Date: **7/21/2020**
Permit Type:
Description: **Electric - Northside Women's Wellness Center**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 42132
Status:
Valuation: $500.00
Contractor Company:
Contractor Name: Salina Crossing Housing Dev

ADJOINING PROPERTY FINDINGS

Date:	**6/16/2020**
Permit Type:	
Description:	**Northside Women's wellness center build outRACK # 50Band IPSLen Paradaice-315-420-1881******CO TYPED-AWAITING SIGNATURES 6/20/2023CO ISSUED 10/16/2024**
Permit Description:	**Com. Reno/Rem/Chg Occ**
Work Class:	
Proposed Use:	
Permit Number:	39888
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Rich & Gardner Construction Co.

Date:	**3/28/2016**
Permit Type:	
Description:	**HVAC**
Permit Description:	**HVAC/Mechanical**
Work Class:	
Proposed Use:	
Permit Number:	23266
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Salina Crossing Housing Dev. Fund

Date:	**3/21/2016**
Permit Type:	
Description:	**Sprinkler**
Permit Description:	**Sprinkler**
Work Class:	
Proposed Use:	
Permit Number:	23203
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	SalinaCrossingHousingDevFund

ADJOINING PROPERTY FINDINGS

Date: **3/9/2016**
Permit Type:
Description: **Sprinkler-Floors B & 1**

Permit Description: **Sprinkler**
Work Class:
Proposed Use:
Permit Number: 23076
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Salina Crossing Comm Enterp

Date: **3/9/2016**
Permit Type:
Description: **Sprinkler-Floors 2 & 3**

Permit Description: **Sprinkler**
Work Class:
Proposed Use:
Permit Number: 23077
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Salina Crossing Comm Enterp

Date: **1/27/2016**
Permit Type:
Description: **Fire Alarm**

Permit Description: **Fire Alarm**
Work Class:
Proposed Use:
Permit Number: 22366
Status:
Valuation: $2,500.00
Contractor Company:
Contractor Name: Salina Crossing Comm Enterp

ADJOINING PROPERTY FINDINGS

Date: **1/26/2016**
Permit Type:
Description: **Electrical-Residential work only**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 22631
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Salina Crossing Comm Enterp

Date: **12/29/2015**
Permit Type:
Description: **1 commercial unit shell onlysee permit # 16581 for feesMixed use buildingA final report is required for SPECIAL INSPECTIONS prior to issuance of C/O*****SEE 16581********

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 98829
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Salina Crossing Comm Enterp

Date: **12/24/2015**
Permit Type:
Description: **Electrical-20 apts & 1 comm shell unit**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 22365
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Salina Crossing Comm Enterp

ADJOINING PROPERTY FINDINGS

Date:	**8/19/2015**
Permit Type:	
Description:	**Hydraulic elevator**
Permit Description:	**Elevator**
Work Class:	
Proposed Use:	
Permit Number:	20318
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Salina Crossing Housing Dev

Date:	**11/14/2014**
Permit Type:	
Description:	**new building with 20 apts See permit # 98829 for 1 commercial unit shell only a separate permit is required for C/O Includes 906 Mcbride St N, Re-sub requiredContact: Ken Woollacott 472-3820A final report is required for SPECIAL INSPECTIONS prior to issuance of C/O******TCO issued 10/28/2016**********Plumbing cert received 11/2/2016***C OF O issued 12/16/2016**
Permit Description:	**Com. New Building**
Work Class:	
Proposed Use:	
Permit Number:	16581
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Housing Visions Construction

ADJOINING PROPERTY FINDINGS

Date: **11/14/2014**
Permit Type:
Description: **Site work**

Permit Description: **Site Work**
Work Class:
Proposed Use:
Permit Number: 16607
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syr Nbrhd Devel Partners LLC

Date: **5/23/2012**
Permit Type:
Description: **Demo 3 story masonary commercial warehouse per the attached approvals.**

Permit Description: **Demolition**
Work Class:
Proposed Use:
Permit Number: 06575
Status:
Valuation: $160,000.00
Contractor Company:
Contractor Name: Syr Nbrhd Devel Partners LLC

Date: **1/23/2012**
Permit Type:
Description: **Demo 2 story wood frame 1 family per the attached approvals**

Permit Description: **Demolition**
Work Class:
Proposed Use:
Permit Number: 06574
Status:
Valuation: $7,500.00
Contractor Company:
Contractor Name: Syr Nbrhd Devel Partners LLC

ADJOINING PROPERTY FINDINGS

901 S MCBRIDE ST

Date:	**8/7/2015**
Permit Type:	
Description:	**901-15 South McBride Street (Building #29) Roof repair**
Permit Description:	**Com. Reno/Rem/Chg Occ**
Work Class:	
Proposed Use:	
Permit Number:	19634
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Syr Housing Authority

Date:	**8/7/2015**
Permit Type:	
Description:	**Roof repair-A.K.A Address: 120-22 Tyler Court (Building #35)**
Permit Description:	**Com. Reno/Rem/Chg Occ**
Work Class:	
Proposed Use:	
Permit Number:	19635
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Syr Housing Authority

Date:	**8/7/2015**
Permit Type:	
Description:	**Roof repair-A.K.A Address: 1001-15 South McBride Street (Building #37)**
Permit Description:	**Com. Reno/Rem/Chg Occ**
Work Class:	
Proposed Use:	
Permit Number:	19636
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Syr Housing Authority

ADJOINING PROPERTY FINDINGS

Date: **8/7/2015**
Permit Type:
Description: **Roof repair-A.K.A Address: 133-35 Stewart Court (Building #38)**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 19637
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syr Housing Authority

Date: **8/7/2015**
Permit Type:
Description: **Roof repair-A.K.A Address: 117-31 Stewart Court (Building #43)**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 19638
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syr Housing Authority

Date: **8/7/2015**
Permit Type:
Description: **Roof repair-A.K.A Address: 1017-31 South McBride Street (Building #44)**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 19639
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syr Housing Authority

ADJOINING PROPERTY FINDINGS

Date: **8/7/2015**
Permit Type:
Description: **Roof repair-A.K.A Address: 1033-47 South McBride Street (Building #45)**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 19640
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syr Housing Authority

Date: **8/7/2015**
Permit Type:
Description: **Roof repair-A.K.A Address: 101-15 Stewart Court (Building #46)**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 19641
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syr Housing Authority

Date: **7/31/2006**
Permit Type: **COMMERCIAL**
Description: **INSTALLATION OF TRAFFIC GATES, BOLLARDS, POST AND CHAIN AND ASSOCIATED WORK PER HOUISING AUTHORITY PLANS ATTACHED.**

Permit Description: **FENCE**
Work Class:
Proposed Use:
Permit Number: 76795
Status:
Valuation: $64,525.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date: **7/18/2006**
Permit Type: **COMMERCIAL**
Description:

Permit Description: **ELECTRICAL**
Work Class:
Proposed Use:
Permit Number: 76929
Status:
Valuation: $20,000.00
Contractor Company:
Contractor Name:

Date: **9/7/2005**
Permit Type: **RESIDENTIAL**
Description: **135 STEWART CT**

Permit Description: **HEATING**
Work Class:
Proposed Use:
Permit Number: 73398
Status:
Valuation: $110,100.00
Contractor Company:
Contractor Name:

Date: **9/7/2005**
Permit Type: **RESIDENTIAL**
Description: **134 STEWART CT**

Permit Description: **HEATING**
Work Class:
Proposed Use:
Permit Number: 73397
Status:
Valuation: $110,100.00
Contractor Company:
Contractor Name:

ADJOINING PROPERTY FINDINGS

Date: **7/12/2000**
Permit Type: **RESIDENTIAL**
Description:

Permit Description: **INTRUSION ALARM SYSTEM**
Work Class:
Proposed Use:
Permit Number: 46451
Status:
Valuation: $195.00
Contractor Company:
Contractor Name:

915 S MCBRIDE ST

Date: **9/24/2018**
Permit Type:
Description: **Fire Alarm Cathedral at Pompei School**

Permit Description: **Fire Alarm**
Work Class:
Proposed Use:
Permit Number: 35271
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Church-Our Lady Of Pompei

Date: **7/8/2016**
Permit Type:
Description: **Fire alarm**

Permit Description: **Fire Alarm**
Work Class:
Proposed Use:
Permit Number: 24331
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Church-Our Lady Of Pompei

ADJOINING PROPERTY FINDINGS

Date: **8/28/2013**
Permit Type:
Description: **Electrical - lighting.**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 12273
Status:
Valuation: $2,500.00
Contractor Company:
Contractor Name: Church-Our Lady Of Pompei

Date: **11/2/2012**
Permit Type:
Description: **SMART WATT LIGHTING UPGRADE**

Permit Description: **Electric**
Work Class:
Proposed Use:
Permit Number: 09068
Status:
Valuation: $791.00
Contractor Company:
Contractor Name: Church-Our Lady Of Pompei

916 S MCBRIDE ST

Date: **10/25/2016**
Permit Type:
Description: **Expand driveway by 3,000 square feet.**

Permit Description: **Misc.(deck, fence,ramp)**
Work Class:
Proposed Use:
Permit Number: 25439
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Church-Our Lady Of Pompei

ADJOINING PROPERTY FINDINGS

Date:	**9/27/2016**
Permit Type:	
Description:	**Fence**
Permit Description:	**Misc.(deck, fence,ramp)**
Work Class:	
Proposed Use:	
Permit Number:	25440
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Church-Our Lady Of Pompei

Date:	**11/2/2012**
Permit Type:	
Description:	**SMARTWATT LIGHTING UPGRADE**
Permit Description:	**Electric**
Work Class:	
Proposed Use:	
Permit Number:	09067
Status:	
Valuation:	$466.00
Contractor Company:	
Contractor Name:	Church-Our Lady Of Pompei

ADJOINING PROPERTY FINDINGS

S TOWNSEND ST

1013 S TOWNSEND ST

Date:	**10/23/2012**
Permit Type:	
Description:	**Demo wood/masonary 1-1/2 story commercial structure per the attached approvals.**
Permit Description:	**Demolition**
Work Class:	
Proposed Use:	
Permit Number:	08901
Status:	
Valuation:	$210.00
Contractor Company:	
Contractor Name:	700 N. Salina St LLC

1101 S TOWNSEND ST

Date:	**6/23/2015**
Permit Type:	
Description:	**1100-14 South McBride Street (Building #5) Roof**
Permit Description:	**Com. Reno/Rem/Chg Occ**
Work Class:	
Proposed Use:	
Permit Number:	19617
Status:	
Valuation:	$0.00
Contractor Company:	
Contractor Name:	Syr Housing Authority

ADJOINING PROPERTY FINDINGS

Date: **6/23/2015**
Permit Type:
Description: **101-15 Radisson Court (Building #6) Roof**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 19618
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syr Housing Authority

Date: **6/23/2015**
Permit Type:
Description: **1100-14 Radisson Court (Building #7) Roof**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 19619
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syr Housing Authority

Date: **6/23/2015**
Permit Type:
Description: **1101-15 South Townsend Street (Building #8) Roof**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 19620
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syr Housing Authority

ADJOINING PROPERTY FINDINGS

Date: **6/17/2015**
Permit Type:
Description: **AKA 1117-31 South Townsend Street (Building #1)-roof repair**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 19613
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syr Housing Authority

Date: **6/17/2015**
Permit Type:
Description: **116-18 Radisson Court (Building #2) Roof**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 19614
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syr Housing Authority

Date: **6/17/2015**
Permit Type:
Description: **117-19 Radisson Court (Building #3) Roof**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 19615
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syr Housing Authority

ADJOINING PROPERTY FINDINGS

Date: **6/17/2015**
Permit Type:
Description: **1116-30 South McBride Street (Building #4) Roof**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 19616
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Syr Housing Authority

1109 S TOWNSEND ST

Date: **4/20/2020**
Permit Type:
Description: **Fire Alarm - Isabella Lofts*Per Kevin, not mailing a copy out due to age. JB**

Permit Description: **Fire Alarm**
Work Class:
Proposed Use:
Permit Number: 39721
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Franciscan Properties Inc

Date: **9/11/2015**
Permit Type:
Description: **Sprinkler**

Permit Description: **Sprinkler**
Work Class:
Proposed Use:
Permit Number: 20900
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Franciscan Properties Inc

ADJOINING PROPERTY FINDINGS

Date: **7/21/2015**
Permit Type:
Description: **Landing & steps repairs**

Permit Description: **Com. Reno/Rem/Chg Occ**
Work Class:
Proposed Use:
Permit Number: 20018
Status:
Valuation: $0.00
Contractor Company:
Contractor Name:

Date: **8/1/2014**
Permit Type:
Description: **sprinkler**

Permit Description: **Sprinkler**
Work Class:
Proposed Use:
Permit Number: 16228
Status:
Valuation: $0.00
Contractor Company:
Contractor Name: Franciscan Properties Inc

ADJOINING PROPERTY FINDINGS

Date:	**7/6/2012**
Permit Type:	
Description:	**Interior buildout of -1- bathroom on 1st floor and repair of 3 sets of exterior stone/concrete/masonry stairs, as per the attached architectural plans dated 4-11-2012;Separate permits required for any electric, hvac, plumb, etc; Must comply with the Building Code of NYS for safeguards during construction.**
Permit Description:	**Com. Reno/Rem/Chg Occ**
Work Class:	
Proposed Use:	
Permit Number:	07216
Status:	
Valuation:	$34,850.00
Contractor Company:	
Contractor Name:	Franciscan Properties Inc

GLOSSARY

General Building Department concepts

- **ICC:** The International Code Council. The governing body for the building/development codes used by all jurisdictions who've adopted the ICC guidelines. MOST of the US has done this. Canada, Mexico, and other countries use ICC codes books and guides as well. There are a few states who have added guidelines to the ICC codes to better fit their needs. For example, California has added seismic retrofit requirements for most commercial structures.
- **Building Department (Permitting Authority, Building Codes, Inspections Department, Building and Inspections):** This is the department in a jurisdiction where an owner or contractor goes to obtain permits and inspections for building, tearing down, remodeling, adding to, re-roofing, moving or otherwise making changes to any structure, Residential or Commercial.
- **Jurisdiction:** This is the geographic area representing the properties over which a Permitting Authority has responsibility.
- **GC:** General Contractor. Usually the primary contractor hired for any Residential or Commercial construction work.
- **Sub:** Subordinate contracting companies or subcontractors. Usually a "trades" contractor working for the GC. These contractors generally have an area of expertise in which they are licensed like Plumbing, Electrical, Heating and Air systems, Gas Systems, Pools etc. (called "trades").
- **Journeymen:** Sub contractors who have their own personal licenses in one or more trades and work for different contracting companies, wherever they are needed or there is work.
- **HVAC (Mechanical, Heating & Air companies):** HVAC = Heating, Ventilation, and Air Conditioning.
- **ELEC (Electrical, TempPole, TPole, TPower, Temporary Power, Panel, AMP Change, Power Release):** Electrical permits can be pulled for many reasons. The most common reason is to increase the AMPs of power in an electrical power panel. This requires a permit in almost every jurisdiction. Other commons reason for Electrical permits is to insert a temporary power pole at a new construction site. Construction requires electricity, and in a new development, power has yet to be run to the lot. The temporary power pole is usually the very first permit pulled for new development. The power is released to the home owner when construction is complete and this sometimes takes the form of a Power Release permit or inspection.
- **"Pull" a permit:** To obtain and pay for a building permit.
- **CBO:** Chief Building Official
- **Planning Department:** The department in the development process where the building /structural plans are reviewed for their completeness and compliance with building codes
- **Zoning Department:** The department in the development process where the site plans are reviewed for their compliance with the regulations associated with the zoning district in which they are situated.
- **Zoning District:** A pre-determined geographic boundary within a jurisdiction where certain types of structures are permitted / prohibited. Examples are Residential structure, Commercial/Retail structures, Industrial/Manufacturing structures etc. Each zoning district has regulations associated with it like the sizes of the lots, the density of the structures on the lots, the number of parking spaces required for certain types of structures on the lots etc.
- **PIN (TMS, GIS ID, Parcel#):** Property Identification Number and Tax Map System number.
- **State Card (Business license):** A license card issued to a contractor to conduct business.
- **Building Inspector (Inspector):** The inspector is a building department employee that inspects building construction for compliance to codes.
- **C.O.:** Certificate of Occupancy. This is the end of the construction process and designates that the owners now have permission to occupy a structure after its building is complete. Sometimes also referred to as a Certificate of Compliance.

GLOSSARY

Permit Content Definitions

- Permit Number: The alphanumerical designation assigned to a permit for tracking within the building department system. Sometimes the permit number gives clues to its role, e.g. a "PL" prefix may designate a plumbing permit.
- Description: A field on the permit form that allows the building department to give a brief description of the work being done. More often than not, this is the most important field for EP's to find clues to the prior use (s) of the property.
- Permit Type: Generally a brief designation of the type of job being done. For example BLDG-RES, BLDG-COM, ELEC, MECH etc.

Sample Building Permit Data

Date: Nov 09, 2000
Permit Type: Bldg -
New Permit Number: 101000000405
Status: Valuation: $1,000,000.00
Contractor Company: OWNER-BUILDER
Contractor Name:

Description: New one store retail (SAV-ON) with drive-thru pharmacy. Certificate of Occupancy.

East Adams Redevelopment - Phase 6 Area
100 Raddison Court
Syracuse, NY 13202

Inquiry Number: 8026566.6
June 23, 2025

The EDR Property Tax Map Report

EDR® Environmental Data Resources Inc

6 Armstrong Road
Shelton, CT 06484
800.352.0050
www.edrnet.com

EDR Property Tax Map Report

Environmental Data Resources, Inc.'s EDR Property Tax Map Report is designed to assist environmental professionals in evaluating potential environmental conditions on a target property by understanding property boundaries and other characteristics. The report includes a search of available property tax maps, which include information on boundaries for the target property and neighboring properties, addresses, parcel identification numbers, as well as other data typically used in property location and identification.

NO COVERAGE

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction orforecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

East Adams Redevelopment - Phase 6 Area
100 Raddison Court
Syracuse, NY 13202

Inquiry Number: 8026566.8S
June 25, 2025

EDR Environmental Lien and AUL Search 1980

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

EDR Environmental Lien and AUL Search 1980

The EDR Environmental Lien and AUL Search 1980 report provides results from a search of available land title records for environmental cleanup liens and other activity and use limitations (AULs), such as engineering controls and institutional controls.

A network of professional, trained researchers, following established procedures, uses client supplied address and/or parcel information to:

- search for parcel number and/or legal description
- search for ownership information filed between 1980 and the most current publicly available date
- research official land title documents recorded at jurisdictional agencies such as recorders' offices, registries of deeds, county clerks' offices, etc.
- search for publicly available environmental encumbering instrument(s) filed between 1980 and present
- provide a copy of any environmental encumbrance(s)
- provide a copy of the current deed when available

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Property Archives, LLC researched and compiled the land title information contained in this EDR Environmental Lien and AUL Search 1980 report on behalf of EDR.

Property Archives

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC and Property Archives, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT. Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2025 by Environmental Data Resources, LLC. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, LLC, or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

EDR Environmental Lien and AUL Search 1980

TARGET PROPERTY INFORMATION

ADDRESS

East Adams Redevelopment - Phase 6 Area
100 Raddison Court
Syracuse, NY, 13202

PROPERTY DESCRIPTION

Parcel ID: **311500 095.-12-01.0**

Current Owner: Syracuse Housing Authority

Legal Description: LOT 77 TO 88 BL 252 TR ABAND ST 268.65 X 4O3.46 X 268.67

FINDINGS SUMMARY

The following is a summary of information contained in the report. Additional details may be found in the Findings Detail section.

Parcel: **311500 095.-12-01.0**

Environmental Lien: Found ☐ Not Found ☒

Other Activity and Use Limitations (AULs): Found ☐ Not Found ☒

HISTORICAL CHAIN of TITLE FROM 1980			
RECORDED	**INSTRUMENT**	**GRANTEE**	**GRANTOR**
		Syracuse Housing Authority	

RESEARCH SOURCE(S)

The following research sources were reviewed from January 01, 1980, to June 18, 2025. Based on available information evaluated by the title search professional, the jurisdiction does not require a search of judicial records to identify environmental liens.

Source 1: Syracuse Township Assessor
Onondaga County, NY

Source 2: Onondaga County Clerk
Onondaga County, NY

EDR Environmental Lien and AUL Search 1980

FINDINGS DETAIL

Parcel: **311500 095.-12-01.0**

ENVIRONMENTAL LIEN

Environmental Lien: Found ☐ Not Found ☒

OTHER ACTIVITY AND USE LIMITATIONS (AULs)

Other AULs: Found ☐ Not Found ☒

MISCELLANEOUS DOCUMENTS

None

HISTORICAL CHAIN OF TITLE FROM 1980

Parcel ID: 311500 095.-12-01.0

Public records of Onondaga County, New York were searched from January 1, 1980 through June 18, 2025 and no deeds vesting title in the subject parcel were located during the period searched.

Appendix F Environmental Database Report

East Adams Redevelopment - Phase 6 Area
100 Raddison Court
Syracuse, NY 13202

Inquiry Number: 8026566.2s
June 23, 2025

The EDR Radius Map™ Report with GeoCheck®

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	9
Orphan Summary	973
Government Records Searched/Data Currency Tracking	GR-1

GEOCHECK ADDENDUM

Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-5
Physical Setting Source Map	A-10
Physical Setting Source Map Findings	A-12
Physical Setting Source Records Searched	PSGR-1

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. **NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA) INFORMATION PROVIDED IN THIS REPORT.** Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2025 by Environmental Data Resources, LLC. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, LLC, or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E1527 - 21), the ASTM Standard Practice for Environmental Site Assessments for Forestland or Rural Property (E2247 - 16), the ASTM Standard Practice for Limited Environmental Due Diligence: Transaction Screen Process (E1528 - 22) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

100 RADDISON COURT
SYRACUSE, NY 13202

COORDINATES

Latitude (North):	43.0399030 - 43° 2' 23.65''
Longitude (West):	76.1447880 - 76° 8' 41.23''
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	406747.6
UTM Y (Meters):	4765667.0
Elevation:	402 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	14115660 SYRACUSE WEST, NY
Version Date:	2019
East Map:	14115658 SYRACUSE EAST, NY
Version Date:	2019

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from:	20221014, 20221103
Source:	USDA

MAPPED SITES SUMMARY

Target Property Address:
100 RADDISON COURT
SYRACUSE, NY 13202

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
A1	SYRACUSE HOUSING AUT	116-118 RADISSON COU	FINDS, ECHO	Lower	1 ft.
A2	SYRACUSE HOUSING AUT	116-118 RADISSON COU	RCRA-SQG, NY MANIFEST	Lower	1 ft.
A3	PARKING LOT- 111 RAD	111 RADISON CT	NY Spills	Higher	3, 0.001,
B4	STEAM PLANT	MCBRIDE ST	NY LTANKS	Higher	19, 0.004, SE
B5	INTERSECTION OF	EAST TAYLOR/SOUTH MC	NY Spills	Higher	22, 0.004, SE
B6	STEAM HEAT SYR. UNIV	TALOR & MCBRIDE ST	NY Spills	Higher	37, 0.007, SE
B7	E. TAYLOR AND MCBRID	EAST TAYLOR AND MCBR	NY Spills	Higher	38, 0.007, SE
B8	TAYLOR & MCBRIDE ST.	TAYLOR AND MCBRIDE S	NY Spills	Higher	38, 0.007, SE
B9	SYRACUSE UNIV STEAM	500 EAST TAYLOR ST	NY Spills	Higher	61, 0.012, SE
B10	SYRACUSE UNIVERSITY	500 EAST TAYLOR ST	UST FINDER	Higher	61, 0.012, SE
B11	STEAM STATION	500 EAST TAYLOR ST	NY Spills	Higher	61, 0.012, SE
B12	SYRACUSE UNIVERSITY	500 E TAYLOR ST	RCRA NonGen / NLR, E MANIFEST, NJ MANIFEST	Higher	61, 0.012, SE
B13	SU CHILLED WATER PLA	500 E. TAYLOR STREET	NY AST, NY CBS AST	Higher	61, 0.012, SE
B14	SYRACUSE UNIVERSITY	500 E TAYLOR ST	NY LTANKS, NY Spills, NY AIRS	Higher	61, 0.012, SE
B15	SYRACUSE UNIVERSITY	500 EAST TAYLOR ST	NY UST, NY AST	Higher	61, 0.012, SE
B16	SYRACUSE UNIVERSITY	500 E. TAYLOR STREET	NY CBS AST	Higher	61, 0.012, SE
B17	SU CHILLED WATER PLA	500 E. TAYLOR STREET	NY CBS, NY AST, NY Spills, NY MANIFEST	Higher	61, 0.012, SE
B18	PROJECT ORANGE	OLD S.U. STEAM PLANT	NY Spills	Higher	136, 0.026, ESE
B19	MC BRIDE SUB	S MCBRIDE	RCRA NonGen / NLR, NY MANIFEST	Higher	237, 0.045, SE
C20	CITY OWNED APARTMENT	301-311 EAST TAYLOR	NY Spills	Lower	285, 0.054, WSW
D21	ERP SITE	1226 MCBRIDE ST	NY Spills	Higher	298, 0.056, SSE
D22	MCKINNEY PROPERTY	1226 SOUTH MCBRIDE S	NY ENG CONTROLS, NY INST CONTROL, NY ERP, NY...	Higher	298, 0.056, SSE
D23	SYRACUSE HOUSING AUT	409 BURT ST	RCRA-LQG, FINDS, ECHO, NY MANIFEST	Lower	366, 0.069, South
E24	ONONDAGA PLAZA	LINCOLN CENTER	NY Spills	Lower	388, 0.073, NW
D25	SYRACUSE HOUSING AUT	BURT & MCBRIDE ST	PA MANIFEST	Higher	412, 0.078, SSE
E26	NY1-1 PIONEER HOMES	ADAMS/RENWICK/TAYLOR	NY UST	Lower	418, 0.079, NW
F27	PROJECT ORANGE	520 E TAYLOR ST	NY CBS, NY AST, NY CBS AST, NY Spills, RCRA NonGen...	Higher	487, 0.092, ESE
28	SYRACUSE HOUSING AUT	101-102 DYER COURT	RCRA-VSQG	Higher	504, 0.095, ENE
C29	THE SALVATION ARMY	1105 S. STATE ST	UST FINDER	Lower	511, 0.097, WSW
C30	FORMER SALVATION ARM	1105 SOUTH STATE ST	UST FINDER RELEASE	Lower	511, 0.097, WSW
C31	EAST ADAMS REDEVELOP	1105-1117 SOUTH STAT	NY BROWNFIELDS, NY PFAS	Lower	511, 0.097, WSW
C32	THE SALVATION ARMY	1105 S. STATE ST	NY UST	Lower	511, 0.097, WSW
C33	SALVATION ARMY	1105 SOUTH STATE ST	UST FINDER RELEASE	Lower	511, 0.097, WSW
C34	SPILL NUMBER 8601904	1105 SOUTH STATE ST	NY Spills	Lower	511, 0.097, WSW
C35	FORMER SALVATION ARM	1105 SOUTH STATE ST	NY LTANKS, NY Spills	Lower	511, 0.097, WSW
C36	ROTH BROS METAL CO.	1107 S. STATE STREET	SEMS-ARCHIVE, LEAD SMELTERS	Lower	512, 0.097, WSW
G37	DI PINO ANTHONY	1117 SOUTH STATE ST	EDR Hist Auto	Lower	524, 0.099, WSW
G38	FORMER SALVATION ARM	1117 SOUTH STATE ST	NY UST	Lower	524, 0.099, WSW
H39	CENTRAL VILLAGE HOUS	302 BURT ST	UST FINDER	Lower	551, 0.104, SW

MAPPED SITES SUMMARY

Target Property Address:
100 RADDISON COURT
SYRACUSE, NY 13202

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
H40	CENTRAL VILLAGE HOUS	302 BURT ST	NY UST	Lower	551, 0.104, SW
F41	SU STEAM STATION	550 E TAYLOR ST	NY Spills	Higher	553, 0.105, ESE
H42	EAST ADAMS REDEVELOP	300 BURT STREET	NY BROWNFIELDS	Lower	554, 0.105, SW
F43	NYSDOT BIN 1031569	I-81/EAST ADAMS STRE	RCRA NonGen / NLR, NY MANIFEST	Higher	558, 0.106, East
I44	S STATE STREET	S STATE ST/NEW STREE	NY LTANKS	Lower	564, 0.107, West
45	SYRACUSE HOUSING AUT	516 BURT ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST	Higher	592, 0.112, SE
F46	SYRACUSE HOUSING AUT	1207 ALMOND ST	RCRA-SQG, E MANIFEST, NY MANIFEST	Higher	603, 0.114, ESE
F47	SYRACUSE HOUSING AUT	1207 ALMOND STREET	PA MANIFEST	Higher	603, 0.114, ESE
48	NIAGARA MOHAWK POWER	235 OAKWOOD AVE. EXT	NY LTANKS, NY Spills, NY MANIFEST	Lower	693, 0.131, SSW
I49	SYRACUSE HOUSING AUT	218 NEW ST	RCRA-SQG, NY MANIFEST	Lower	714, 0.135, WNW
I50	SYRACUSE HOUSING AUT	218 NEW STREET	PA MANIFEST	Lower	714, 0.135, WNW
51	NYS TEAMSTERS	NEW STREET	NY LTANKS	Lower	715, 0.135, WNW
J52	EAST ADAMS REDEVELOP	100 ANGELOU TERRACE	NY BROWNFIELDS	Lower	809, 0.153, NW
K53	1210 S STATE ST	1210 S STATE ST	US BROWNFIELDS, FINDS	Lower	815, 0.154, SW
54	SYRACUSE HOUSING AUT	120-122 TYLER COURT	RCRA-SQG, NY MANIFEST	Lower	837, 0.159, NNE
K55	1212 S STATE ST	1212 S STATE ST	US BROWNFIELDS, FINDS	Lower	838, 0.159, SW
J56	SYRACUSE POLICE DEPT	916 S STATE ST	NY UST	Lower	846, 0.160, NW
J57	SYRACUSE POLICE DEPT	916 S STATE ST	UST FINDER	Lower	846, 0.160, NW
K58	1214 S STATE ST	1214 S STATE ST	US BROWNFIELDS, FINDS	Lower	862, 0.163, SW
L59	917 MONTGOMERY STREE	917 MONTGOMERY STREE	US BROWNFIELDS, FINDS	Lower	883, 0.167, WSW
J60	NIAGARA MOHAWK A NAT	900 SOUTH STATE STRE	NY MANIFEST	Lower	920, 0.174, NW
J61	FIRE STATION #1	900 SOUTH STATE ST	NY UST	Lower	920, 0.174, NW
J62	FIRE STATION #1	900 SOUTH STATE ST	UST FINDER	Lower	920, 0.174, NW
J63	FIRE STATION #1	900 SOUTH STATE ST	NY AST	Lower	920, 0.174, NW
J64	NIAGARA MOHAWK - A N	900 SOUTH STATE ST	RCRA NonGen / NLR, E MANIFEST	Lower	920, 0.174, NW
L65	WAREHOUSE	908 MONTGOMERY ST	NY UST	Lower	982, 0.186, WSW
M66	NY1-1 PIONEER HOMES	ADAMS/RENWICK/TAYLOR	NY AST	Lower	1050, 0.199, NW
M67	ADAMS & STATE ST. GA	ADAMS & STATE STREET	NY LTANKS	Lower	1065, 0.202, NW
M68	ADAMS & STATE ST. GA	ADAMS & STATE STREET	UST FINDER RELEASE	Lower	1065, 0.202, NW
N69	NYSDOT BIN 7706370 -	522 RENWICK AVE	NY MANIFEST	Higher	1085, 0.205, SE
N70	NYSDOT BIN 7706370 -	522 RENWICK AVE	RCRA NonGen / NLR, FINDS, ECHO	Higher	1085, 0.205, SE
71	SUNY HEALTH SCIENCE		PFAS ECHO	Higher	1137, 0.215, NE
72	SYRACUSE UNIVERSITY	401 VAN BUREN ST	RCRA NonGen / NLR, FINDS, ECHO, E MANIFEST, NY...	Higher	1146, 0.217, SE
O73	SOUTH SALINA SIDA	1016-1018 MONTGOMERY	NY SHWS	Lower	1162, 0.220, SW
P74	FAMILY DOLLAR #5071	945 S SALINA ST	NY MANIFEST	Lower	1202, 0.228, WSW
P75	FAMILY DOLLAR #5071	945 S SALINA ST	RCRA-VSQG, ECHO	Lower	1202, 0.228, WSW
M76	CENTRAL TECH	285 E. ADAMS ST	UST FINDER	Lower	1207, 0.229, NW
77	CENTRO PARKING INC.	SUNY HEALTH SRV. CEN	NY LTANKS	Lower	1237, 0.234, North
Q78	INSTITUTE OF TECHNOL	258 E ADAMS ST	RCRA NonGen / NLR, NY MANIFEST	Lower	1248, 0.236, NW

MAPPED SITES SUMMARY

Target Property Address:
100 RADDISON COURT
SYRACUSE, NY 13202

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
Q79	CENTRAL TECH VOCATIO	258 EAST ADAMS ST	NY UST	Lower	1248, 0.236, NW
Q80	SYRACUSE CITY SCHOOL	258 E ADAMS ST	PA MANIFEST	Lower	1248, 0.236, NW
81	TRIPP KATIE	1429 S MCBRIDE ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST	Lower	1283, 0.243, SSE
M82	ONONDAGA CO CONVENTI	S STATE ST	RCRA NonGen / NLR, NY MANIFEST	Lower	1294, 0.245, NNW
P83	SYRACUSE COMMUNITY H	930 S SALINA ST	RCRA-SQG, FINDS, ECHO, NY MANIFEST	Lower	1316, 0.249, WSW
O84	1045-1047 SOUTH SALI	1045 SOUTH SALINA ST	US BROWNFIELDS, FINDS	Lower	1324, 0.251, SW
O85	1049-1071 SOUTH SALI	1049-1071 SOUTH SALI	US BROWNFIELDS, FINDS	Lower	1378, 0.261, SW
R86	1073-1079 SOUTH SALI	1073-1079 SOUTH SALI	US BROWNFIELDS, FINDS	Lower	1436, 0.272, SW
R87	1081-1085 SOUTH SALI	1081-1085 SOUTH SALI	US BROWNFIELDS, FINDS	Lower	1457, 0.276, SW
R88	SOUTH SALINA STREET	1081 SOUTH SALINA ST	NY BROWNFIELDS, NY Spills	Lower	1457, 0.276, SW
R89	1101-1111 SOUTH SALI	1101-1111 SOUTH SALI	US BROWNFIELDS, FINDS	Lower	1465, 0.277, SW
S90	680 SOUTH SALINA ST	680 SOUTH SALINA ST	NY LTANKS, NY Spills	Lower	1483, 0.281, WNW
S91	DESIMONES SERVICE ST	680 S. SALINA ST	UST FINDER RELEASE	Lower	1483, 0.281, WNW
T92	V.A. MEDICAL CENTER	800 IRIVING AVENUE	NY LTANKS	Higher	1519, 0.288, ESE
T93	V.A. MEDICAL CENTER	800 IRIVING AVENUE	UST FINDER RELEASE	Higher	1519, 0.288, ESE
94	HARRISON PL & E ADAM	HARRISON PL & E ADAM	NY LTANKS	Lower	1542, 0.292, NW
U95	SUNY UPSTATE	750 EAST ADAMS ST	NY LTANKS, NY CBS, NY AST, NY CBS AST, NY Spills,...	Higher	1567, 0.297, ENE
V96	FORMER COYNE TEXTILE	140 CORTLAND AVENUE	NY ENG CONTROLS, NY INST CONTROL, NY BROWNFIELDS	Lower	1577, 0.299, WSW
V97	RENALLI TAYLOR ST LL	140 CORTLAND AVE	NY LTANKS, NY CBS, NY CBS AST, NY BROWNFIELDS, NY...	Lower	1577, 0.299, WSW
W98	MARATHON WATER SUPPL	MARATHON SCHOOL BUS	NY LTANKS	Lower	1646, 0.312, NNW
U99	CLARK HALL; CROUSE I	ELIZABETH BLACKWELL	NY LTANKS	Higher	1659, 0.314, NE
X100	MONDO'S AGWAY	1127 SO. SALINA ST	UST FINDER RELEASE	Lower	1688, 0.320, SW
X101	1127 SOUTH SALINA SY	1127 SOUTH SALINA ST	NY LTANKS, NY UST, NY Spills	Lower	1688, 0.320, SW
102	SYRACUSE UNIV	900 IRVING AVE	NY LTANKS, NY Spills	Higher	1705, 0.323, ESE
X103	MONDO'S SERVICE STAT	1133 SOUTH SALINA	NY LTANKS	Lower	1713, 0.324, SW
X104	MONDO'S SERVICE STAT	1133 SOUTH SALINA	UST FINDER RELEASE	Lower	1713, 0.324, SW
Y105	743 IRVING AVE.	743 IRVING AVE	NY LTANKS	Higher	1716, 0.325, ENE
Y106	743 IRVING AVE.	743 IRVING AVE	UST FINDER RELEASE	Higher	1716, 0.325, ENE
107	HARRISON CONVENTION	HARRISON & MONTGOMER	UST FINDER RELEASE	Lower	1723, 0.326, NW
108	SYRACUSE UNIVERISTY	OFF SKYTOP RD	NY LTANKS	Higher	1790, 0.339, East
W109	SPILL NUMBER 8601815	600 S. STATE ST @ CI	NY LTANKS	Lower	1846, 0.350, NNW
Z110	CASTLE REST NURSE HO	401 E CASTLE ST	NY LTANKS	Higher	1903, 0.360, South
Z111	CASTLE REST NURSE HO	401 E CASTLE ST	UST FINDER RELEASE	Higher	1903, 0.360, South
X112	1202-04 SOUTH SALINA	1202-04 SOUTH SALINA	US BROWNFIELDS, FINDS	Lower	1910, 0.362, SW
X113	1146 S SALINA STREET	1146 S SALINA STREET	US BROWNFIELDS, FINDS	Lower	1931, 0.366, SW
114	HUTCHING PSYCH CTR T	620 MADISON ST	NY LTANKS, NY Spills	Lower	1964, 0.372, NNE
115	1208-18 SOUTH SALINA	1208-18 SOUTH SALINA	US BROWNFIELDS, FINDS	Lower	1984, 0.376, SW
116	S&F AUTOMOTIVE	420 ONEIDA ST	NY LTANKS	Lower	2006, 0.380, West
AA117	HARRISON PARKING GAR	WARREN & HARRISON ST	NY LTANKS	Lower	2059, 0.390, NW

MAPPED SITES SUMMARY

Target Property Address:
100 RADDISON COURT
SYRACUSE, NY 13202

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
AA118	HARRISON PARKING GAR	WARREN & HARRISON ST	UST FINDER RELEASE	Lower	2059, 0.390, NW
119	JMA CAMPUS PLAN	623 ONEIDA STREET	NY BROWNFIELDS	Lower	2077, 0.393, WSW
AB120	BYRNE DAIRY	KING ST	NY LTANKS	Lower	2102, 0.398, WSW
AC121	MONTGOMERY STREET	MONGOMERY ST AND MAD	NY LTANKS	Lower	2110, 0.400, NNW
AB122	BYRNE DAIRY	235 KING STREET	NY LTANKS	Lower	2117, 0.401, WSW
AD123	DISTRICT HEATING & C	601 S STATE ST	NY LTANKS, NY Spills, NY AIRS, NY MANIFEST	Lower	2168, 0.411, NNW
AD124	STEAM STATION-S.STAT	601 S. STATE ST	UST FINDER RELEASE	Lower	2168, 0.411, NNW
125	BYRNE DAIRY INC.	240 ONEIDA STREET	NY LTANKS, NY UST, NY CBS, NY AST, NY Spills, NY...	Lower	2183, 0.413, West
AE126	HUTCHINGS	500 CEDAR ST	UST FINDER RELEASE	Lower	2194, 0.416, NNE
127	HUTCHINGS PHSYC CENT	625 MADISON STREET	NY LTANKS, NY Spills	Higher	2206, 0.418, NE
AE128	HUTCHINGS PSYCHIATRI	BLDG 11	NY LTANKS	Lower	2218, 0.420, NNE
AF129	500 SOUTH SALINA STR	500 SOUTH SALINA STR	UST FINDER RELEASE	Lower	2246, 0.425, WNW
AF130	CHIMES BUILDING	500-550 SOUTH SALINA	NY BROWNFIELDS	Lower	2246, 0.425, WNW
AF131	THE CHIMES BUILDING	500-550 SOUTH SALINA	US BROWNFIELDS	Lower	2246, 0.425, WNW
AG132	CNY CENTRO INC	200 CORTLAND AVE	NY LTANKS, NY CBS, NY Spills, NY AIRS	Lower	2256, 0.427, SW
AG133	CENTRAL BUS CNYRTA M	200 CORTLAND AVE	NY LTANKS, NY Spills, NY COOLING TOWERS	Lower	2256, 0.427, SW
AC134	CATHEDRAL IMMACULATE	420 MONTGOMERY AVE	NY LTANKS	Lower	2272, 0.430, NNW
AH135	1357 SALINA STREET S	1357 SALINA STREET S	US BROWNFIELDS, FINDS	Lower	2303, 0.436, SSW
AI136	ATLAS SERVICES	TAYLOR ST; KING ST	NY LTANKS	Lower	2324, 0.440, West
AJ137	CASTLE REST NURSING	116 EAST CASTLE ST	NY LTANKS, NY Spills	Higher	2341, 0.443, SSW
AJ138	SPILL NUMBER 9900884	116 EAST CASTLE ST	UST FINDER RELEASE	Higher	2341, 0.443, SSW
139	HUTCHINGS PSYCH CENT	540 CEDAR - BUILDING	RCRA-VSQG, NY LTANKS, NY Spills, ICIS, FINDS,...	Higher	2342, 0.444, NNE
140	SUNY UPSTATE MEDICAL	505 IRVING AVE	NY SWF/LF, NY COOLING TOWERS	Higher	2394, 0.453, NE
AF141	COUNTY SEWER ROW	CLINTON AND WEST ONO	UST FINDER RELEASE	Lower	2405, 0.455, WNW
142	SYRACUSE UNIVERSITY	M17 SKYTOP RD	NY LTANKS	Higher	2420, 0.458, ESE
AI143	ATLAS LINEN	320 WEST TAYLOR ST	UST FINDER RELEASE	Lower	2435, 0.461, WSW
AK144	PRESIDENTIAL PLAZA	90 PRESIDENTIAL PLAZ	NY LTANKS	Lower	2448, 0.464, North
AK145	PRESIDENTIAL PLAZA	90 PRESIDENTIAL PLAZ	UST FINDER RELEASE	Lower	2448, 0.464, North
AL146	500 WARREN ST	500 WARREN ST	UST FINDER RELEASE	Lower	2451, 0.464, NW
AL147	HOTEL SYRACUSE	500 S WARREN ST	RCRA-VSQG, NY LTANKS, US AIRS, NY MANIFEST	Lower	2451, 0.464, NW
AM148	H.S.M.PACKAGING CORP	123 LARNED ST	NY LTANKS	Lower	2514, 0.476, West
AM149	H.S.M.PACKAGING CORP	123 LARNED ST	UST FINDER RELEASE	Lower	2514, 0.476, West
AH150	1400-20 SALINA STREE	1400-20 SALINA STREE	US BROWNFIELDS, FINDS	Lower	2519, 0.477, SSW
AK151	PRESIDENTIAL PLAZA	PRESIDENTIAL PLAZA	NY LTANKS	Lower	2541, 0.481, North
152	SPILL NUMBER 8601051	CEDAR ST	NY LTANKS	Higher	2560, 0.485, NE
153	NYS ARMORY JEFFERSON	JEFFERSON ST. ARMORY	NY LTANKS	Lower	2574, 0.488, NNW
154	SYRACUSE UNIVERSITY	700 UNIVERSITY AVENU	NY LTANKS	Higher	2627, 0.498, ENE
155	BROWN MANUFACTURING	101 CHESTER ST	NY SHWS, NY ENG CONTROLS, NY INST CONTROL, NY ERP	Lower	4000, 0.758, SW
156	NIMO - SYRACUSE - ER	300 ERIC BLVD WEST	EDR MGP	Lower	4764, 0.902, NW

MAPPED SITES SUMMARY

Target Property Address:
100 RADDISON COURT
SYRACUSE, NY 13202

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
157	NM - SYRACUSE ERIE B	300 ERIE BLVD WEST	NY SHWS, NY LTANKS, NY ENG CONTROLS, NY INST...	Lower	4958, 0.939, NW

EXECUTIVE SUMMARY

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal NPL (Superfund) sites

NPL ---------- National Priority List
Proposed NPL ---------- Proposed National Priority List Sites
NPL LIENS ---------- Federal Superfund Liens

Lists of Federal Delisted NPL sites

Delisted NPL ---------- National Priority List Deletions

Lists of Federal sites subject to CERCLA removals and CERCLA orders

FEDERAL FACILITY ---------- Federal Facility Site Information listing
SEMS ---------- Superfund Enterprise Management System

Lists of Federal RCRA facilities undergoing Corrective Action

CORRACTS ---------- Corrective Action Report

Lists of Federal RCRA TSD facilities

RCRA-TSDF ---------- RCRA - Treatment, Storage and Disposal

Federal institutional controls / engineering controls registries

LUCIS ---------- Land Use Control Information System
US ENG CONTROLS ---------- Engineering Controls Sites List
US INST CONTROLS ---------- Institutional Controls Sites List

Federal ERNS list

ERNS ---------- Emergency Response Notification System

Lists of state and tribal leaking storage tanks

INDIAN LUST ---------- Leaking Underground Storage Tanks on Indian Land
NY HIST LTANKS ---------- Listing of Leaking Storage Tanks

EXECUTIVE SUMMARY

Lists of state and tribal registered storage tanks

FEMA UST ---- Underground Storage Tank Listing
NY CBS UST ---- Chemical Bulk Storage Database
NY MOSF UST ---- Major Oil Storage Facilities Database
NY MOSF ---- Major Oil Storage Facility Site Listing
NY MOSF AST ---- Major Oil Storage Facilities Database
INDIAN UST ---- Underground Storage Tanks on Indian Land
NY TANKS ---- Storage Tank Faciliy Listing

State and tribal institutional control / engineering control registries

NY RES DECL ---- Restrictive Declarations Listing

Lists of state and tribal voluntary cleanup sites

NY VCP ---- Voluntary Cleanup Agreements
INDIAN VCP ---- Voluntary Cleanup Priority Listing

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

NY SWTIRE ---- Registered Waste Tire Storage & Facility List
NY SWRCY ---- Registered Recycling Facility List
INDIAN ODI ---- Report on the Status of Open Dumps on Indian Lands
ODI ---- Open Dump Inventory
DEBRIS REGION 9 ---- Torres Martinez Reservation Illegal Dump Site Locations
IHS OPEN DUMPS ---- Open Dumps on Indian Land

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL ---- Delisted National Clandestine Laboratory Register
NY DEL SHWS ---- Delisted Registry Sites
US CDL ---- National Clandestine Laboratory Register

Local Lists of Registered Storage Tanks

NY HIST UST ---- Historical Petroleum Bulk Storage Database
NY HIST AST ---- Historical Petroleum Bulk Storage Database

Local Land Records

NY LIENS ---- Spill Liens Information
LIENS 2 ---- CERCLA Lien Information

Records of Emergency Release Reports

HMIRS ---- Hazardous Materials Information Reporting System
NY Hist Spills ---- SPILLS Database
NY SPILLS 90 ---- SPILLS 90 data from FirstSearch
NY SPILLS 80 ---- SPILLS 80 data from FirstSearch

Other Ascertainable Records

FUDS ---- Formerly Used Defense Sites

EXECUTIVE SUMMARY

DOD	Department of Defense Sites
SCRD DRYCLEANERS	State Coalition for Remediation of Drycleaners Listing
US FIN ASSUR	Financial Assurance Information
EPA WATCH LIST	EPA WATCH LIST
2020 COR ACTION	2020 Corrective Action Program List
TSCA	Toxic Substances Control Act
TRIS	Toxic Chemical Release Inventory System
SSTS	Section 7 Tracking Systems
ROD	Records Of Decision
RMP	Risk Management Plans
RAATS	RCRA Administrative Action Tracking System
PRP	Potentially Responsible Parties
PADS	PCB Activity Database System
FTTS	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
MLTS	Material Licensing Tracking System
COAL ASH DOE	Steam-Electric Plant Operation Data
COAL ASH EPA	Coal Combustion Residues Surface Impoundments List
PCB TRANSFORMER	PCB Transformer Registration Database
RADINFO	Radiation Information Database
HIST FTTS	FIFRA/TSCA Tracking System Administrative Case Listing
DOT OPS	Incident and Accident Data
CONSENT	Superfund (CERCLA) Consent Decrees
INDIAN RESERV	Indian Reservations
FUSRAP	Formerly Utilized Sites Remedial Action Program
UMTRA	Uranium Mill Tailings Sites
US MINES	Mines Master Index File
MINES MRDS	Mineral Resources Data System
ABANDONED MINES	Abandoned Mines
UXO	Unexploded Ordnance Sites
DOCKET HWC	Hazardous Waste Compliance Docket Listing
FUELS PROGRAM	EPA Fuels Program Registered Listing
PFAS NPL	Superfund Sites with PFAS Detections Information
PFAS FEDERAL SITES	Federal Sites PFAS Information
PFAS TSCA	PFAS Manufacture and Imports Information
PFAS TRIS	List of PFAS Added to the TRI
PFAS RCRA MANIFEST	PFAS Transfers Identified In the RCRA Database Listing
PFAS ATSDR	PFAS Contamination Site Location Listing
PFAS WQP	Ambient Environmental Sampling for PFAS
PFAS PROJECT	NORTHEASTERN UNIVERSITY PFAS PROJECT
PFAS NPDES	Clean Water Act Discharge Monitoring Information
PFAS ECHO FIRE TRAIN	Facilities in Industries that May Be Handling PFAS Listing
PFAS PT 139 AIRPORT	All Certified Part 139 Airports PFAS Information Listing
AQUEOUS FOAM NRC	Aqueous Foam Related Incidents Listing
BIOSOLIDS	ICIS-NPDES Biosolids Facility Data
NY COAL ASH	Coal Ash Disposal Site Listing
NY E DESIGNATION	E DESIGNATION SITE LISTING
NY Financial Assurance	Financial Assurance Information Listing
NY HSWDS	Hazardous Substance Waste Disposal Site Inventory
NY LEAD	Lead-based Paint Testing Results
NY VAPOR REOPENED	Vapor Intrusion Legacy Site List
NY UIC	Underground Injection Control Wells
NY NYC LAND USE	New York City Land Use Information
NY NYC OER	OER Cleanup Sites Listing
NY ILI	New York State Inactive Landfill Initiative

EXECUTIVE SUMMARY

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR Hist Cleaner..... EDR Exclusive Historical Cleaners

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

NY RGA HWS..... Recovered Government Archive State Hazardous Waste Facilities List
NY RGA LF..... Recovered Government Archive Solid Waste Facilities List

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.
Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal CERCLA sites with NFRAP

SEMS-ARCHIVE: SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that. based upon available information, the location is not judged to be potential NPL site.

A review of the SEMS-ARCHIVE list, as provided by EDR, and dated 03/27/2025 has revealed that there is 1 SEMS-ARCHIVE site within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
ROTH BROS METAL CO.	***1107 S. STATE STREET***	***WSW 0 - 1/8 (0.097 mi.)***	***C36***	***304***

EXECUTIVE SUMMARY

Lists of Federal RCRA generators

RCRA-LQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

A review of the RCRA-LQG list, as provided by EDR, and dated 06/02/2025 has revealed that there is 1 RCRA-LQG site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT EPA ID:: NY0000201889	***409 BURT ST***	***S 0 - 1/8 (0.069 mi.)***	***D23***	***218***

RCRA-SQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

A review of the RCRA-SQG list, as provided by EDR, and dated 06/02/2025 has revealed that there are 5 RCRA-SQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT EPA ID:: NYR000154468	***1207 ALMOND ST***	***ESE 0 - 1/8 (0.114 mi.)***	***F46***	***336***

Lower Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT EPA ID:: NYR000154476	***116-118 RADISSON COU***	***0 - 1/8 (0.000 mi.)***	***A2***	***9***
SYRACUSE HOUSING AUT EPA ID:: NYR000171124	***218 NEW ST***	***WNW 1/8 - 1/4 (0.135 mi.)***	***I49***	***367***
SYRACUSE HOUSING AUT EPA ID:: NYR000154492	***120-122 TYLER COURT***	***NNE 1/8 - 1/4 (0.159 mi.)***	***54***	***388***
SYRACUSE COMMUNITY H EPA ID:: NYR000199190	***930 S SALINA ST***	***WSW 1/8 - 1/4 (0.249 mi.)***	***P83***	***520***

RCRA-VSQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Very small quantity generators (VSQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-VSQG list, as provided by EDR, and dated 06/02/2025 has revealed that there are 2 RCRA-VSQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT EPA ID:: NYR000164129	101-102 DYER COURT	ENE 0 - 1/8 (0.095 mi.)	28	287

Lower Elevation	Address	Direction / Distance	Map ID	Page
FAMILY DOLLAR #5071 EPA ID:: NYR000211730	***945 S SALINA ST***	***WSW 1/8 - 1/4 (0.228 mi.)***	***P75***	***482***

Lists of state- and tribal hazardous waste facilities

NY SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Conservation's Inactive Hazardous waste Disposal Sites in New York State.

A review of the NY SHWS list, as provided by EDR, and dated 02/03/2025 has revealed that there are 3 NY SHWS sites within approximately 1 mile of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
SOUTH SALINA SIDA Site Code: 422215	1016-1018 MONTGOMERY	SW 1/8 - 1/4 (0.220 mi.)	O73	478
BROWN MANUFACTURING Site Code: 465076	***101 CHESTER ST***	***SW 1/2 - 1 (0.758 mi.)***	***155***	***906***
NM - SYRACUSE ERIE B Site Code: 56354	***300 ERIE BLVD WEST***	***NW 1/2 - 1 (0.939 mi.)***	***157***	***942***

Lists of state and tribal landfills and solid waste disposal facilities

NY SWF/LF: The Solid Waste Facilities/Landfill Sites records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. The data come from the list.

A review of the NY SWF/LF list, as provided by EDR, and dated 02/20/2025 has revealed that there is 1 NY SWF/LF site within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SUNY UPSTATE MEDICAL	***505 IRVING AVE***	***NE 1/4 - 1/2 (0.453 mi.)***	***140***	***871***

Lists of state and tribal leaking storage tanks

NY LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the NY LTANKS list, as provided by EDR, and dated 02/02/2025 has revealed that there are

EXECUTIVE SUMMARY

46 NY LTANKS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
STEAM PLANT Site ID: 259520 Spill Date: 1999-10-20 Spill Number/Closed Date: 9908800 / 1999-11-23	MCBRIDE ST	SE 0 - 1/8 (0.004 mi.)	B4	16
SYRACUSE UNIVERSITY Site ID: 229011 Site ID: 229012 Spill Date: 1986-11-11 Spill Number/Closed Date: 8605131 / 1988-01-15 Spill Number/Closed Date: 8605148 / 1988-01-15	***500 E TAYLOR ST***	***SE 0 - 1/8 (0.012 mi.)***	***B14***	***46***
V.A. MEDICAL CENTER Site ID: 242917 Site ID: 242920 Spill Date: 2004-05-27 Spill Date: 1998-09-28 Spill Number/Closed Date: 0402165 / 2004-09-29 Spill Number/Closed Date: 9807877 / 2002-08-06	800 IRIVING AVENUE	ESE 1/4 - 1/2 (0.288 mi.)	T92	553
SUNY UPSTATE Site ID: 500005 Spill Date: 2014-09-19 Spill Number/Closed Date: 1406531 / 2015-07-22	***750 EAST ADAMS ST***	***ENE 1/4 - 1/2 (0.297 mi.)***	***U95***	***557***
CLARK HALL; CROUSE I Site ID: 114725 Spill Date: 1988-02-18 Spill Number/Closed Date: 8709940 / 1988-04-12	ELIZABETH BLACKWELL	NE 1/4 - 1/2 (0.314 mi.)	U99	691
SYRACUSE UNIV Site ID: 96874 Spill Date: 2003-01-10 Spill Number/Closed Date: 0210237 / 2003-10-31	***900 IRVING AVE***	***ESE 1/4 - 1/2 (0.323 mi.)***	***102***	***702***
743 IRVING AVE. Site ID: 180766 Spill Date: 1991-05-08 Spill Number/Closed Date: 9101558 / 1991-05-08	743 IRVING AVE	ENE 1/4 - 1/2 (0.325 mi.)	Y105	707
SYRACUSE UNIVERISTY Site ID: 207927 Spill Date: 2004-01-14 Spill Number/Closed Date: 0311616 / 2004-05-04	OFF SKYTOP RD	E 1/4 - 1/2 (0.339 mi.)	108	710
CASTLE REST NURSE HO Site ID: 149961 Spill Date: 1991-01-18 Spill Number/Closed Date: 9011086 / 1991-01-31	401 E CASTLE ST	S 1/4 - 1/2 (0.360 mi.)	Z110	712
HUTCHINGS PHSYC CENT Site ID: 336700 Spill Date: 2005-01-25 Spill Number/Closed Date: 0411489 / 2005-04-14	***625 MADISON STREET***	***NE 1/4 - 1/2 (0.418 mi.)***	***127***	***791***
CASTLE REST NURSING Site ID: 166430 Spill Date: 1999-04-23 Spill Number/Closed Date: 9900884 / 2000-03-20	***116 EAST CASTLE ST***	***SSW 1/4 - 1/2 (0.443 mi.)***	***AJ137***	***833***
HUTCHINGS PSYCH CENT	***540 CEDAR - BUILDING***	***NNE 1/4 - 1/2 (0.444 mi.)***	***139***	***835***

Site ID: 78437
Site ID: 203614
Spill Date: 1988-06-15
Spill Date: 1988-03-31
Spill Number/Closed Date: 8802339 / 1990-01-24
Spill Number/Closed Date: 8710954 / 1988-06-09

SYRACUSE UNIVERSITY — M17 SKYTOP RD — ESE 1/4 - 1/2 (0.458 mi.) — 142 — 873
Site ID: 156486
Spill Date: 1998-08-03
Spill Number/Closed Date: 9805513 / 1998-09-21

SPILL NUMBER 8601051 — CEDAR ST — NE 1/4 - 1/2 (0.485 mi.) — 152 — 902
Site ID: 278500
Spill Date: 1986-05-14
Spill Number/Closed Date: 8601051 / 1988-01-15

SYRACUSE UNIVERSITY — 700 UNIVERSITY AVENU — ENE 1/4 - 1/2 (0.498 mi.) — 154 — 905
Site ID: 100091
Spill Date: 1997-09-11
Spill Number/Closed Date: 9706956 / 1997-12-12

Lower Elevation	Address	Direction / Distance	Map ID	Page
FORMER SALVATION ARM	***1105 SOUTH STATE ST***	***WSW 0 - 1/8 (0.097 mi.)***	***C35***	***302***
Site ID: 61010 Spill Date: 2004-08-04 Spill Number/Closed Date: 0404882 / 2005-03-04				
S STATE STREET	S STATE ST/NEW STREE	W 0 - 1/8 (0.107 mi.)	I44	325
Site ID: 229077 Spill Date: 1992-10-19 Spill Number/Closed Date: 9208359 / 1993-01-26				
NIAGARA MOHAWK POWER	***235 OAKWOOD AVE. EXT***	***SSW 1/8 - 1/4 (0.131 mi.)***	***48***	***343***
Site ID: 327666 Spill Date: 1994-10-24 Spill Number/Closed Date: 9409889 / 1995-04-18				
NYS TEAMSTERS	NEW STREET	WNW 1/8 - 1/4 (0.135 mi.)	51	371
Site ID: 100774 Spill Date: 1990-05-11 Spill Number/Closed Date: 9001641 / 1990-09-13				
ADAMS & STATE ST. GA	ADAMS & STATE STREET	NW 1/8 - 1/4 (0.202 mi.)	M67	458
Site ID: 210798 Spill Date: 1991-11-06 Spill Number/Closed Date: 9108385 / 1991-11-07				
CENTRO PARKING INC.	SUNY HEALTH SRV. CEN	N 1/8 - 1/4 (0.234 mi.)	77	486
Site ID: 323404 Spill Date: 1993-12-23 Spill Number/Closed Date: 9311487 / 2001-02-12				
680 SOUTH SALINA ST	***680 SOUTH SALINA ST***	***WNW 1/4 - 1/2 (0.281 mi.)***	***S90***	***547***
Site ID: 525912 Site ID: 265820 Spill Date: 2016-04-18 Spill Date: 1987-09-28 Spill Number/Closed Date: 1600634 / 2019-12-10 Spill Number/Closed Date: 8705408 / 1987-10-28				
HARRISON PL & E ADAM	HARRISON PL & E ADAM	NW 1/4 - 1/2 (0.292 mi.)	94	556

Site ID: 97685
Spill Date: 1999-02-25
Spill Number/Closed Date: 9814193 / 1999-04-26

RENALLI TAYLOR ST LL	***140 CORTLAND AVE***	***WSW 1/4 - 1/2 (0.299 mi.)***	***V97***	***638***
Site ID: 156885 Spill Date: 1996-07-01 Spill Number/Closed Date: 9604373 / 1996-07-02				
MARATHON WATER SUPPL	MARATHON SCHOOL BUS	NNW 1/4 - 1/2 (0.312 mi.)	W98	689
Site ID: 64963 Spill Date: 1991-07-09 Spill Number/Closed Date: 9104876 / 1996-04-22				
1127 SOUTH SALINA SY	***1127 SOUTH SALINA ST***	***SW 1/4 - 1/2 (0.320 mi.)***	***X101***	***693***
Site ID: 302125 Spill Date: 1985-03-25 Spill Number/Closed Date: 8403634 / 1991-06-17				
MONDO'S SERVICE STAT	1133 SOUTH SALINA	SW 1/4 - 1/2 (0.324 mi.)	X103	705
Site ID: 382878 Spill Date: 2007-06-13 Spill Number/Closed Date: 0703031 / 2007-10-04				
SPILL NUMBER 8601815	600 S. STATE ST @ CI	NNW 1/4 - 1/2 (0.350 mi.)	W109	711
Site ID: 137258 Spill Date: 1986-06-16 Spill Number/Closed Date: 8601815 / 1988-01-15				
HUTCHING PSYCH CTR T	***620 MADISON ST***	***NNE 1/4 - 1/2 (0.372 mi.)***	***114***	***728***
Site ID: 187125 Spill Date: 2003-02-24 Spill Number/Closed Date: 0211660 / 2004-11-26				
S&F AUTOMOTIVE	420 ONEIDA ST	W 1/4 - 1/2 (0.380 mi.)	116	755
Site ID: 194355 Spill Date: 1992-09-24 Spill Number/Closed Date: 9207347 / 1992-10-05				
HARRISON PARKING GAR	WARREN & HARRISON ST	NW 1/4 - 1/2 (0.390 mi.)	AA117	756
Site ID: 121632 Spill Date: 1991-01-05 Spill Number/Closed Date: 9010749 / 1999-11-26				
BYRNE DAIRY	KING ST	WSW 1/4 - 1/2 (0.398 mi.)	AB120	760
Site ID: 109545 Spill Date: 2003-02-22 Spill Number/Closed Date: 0211606 / 2003-07-30				
MONTGOMERY STREET	MONGOMERY ST AND MAD	NNW 1/4 - 1/2 (0.400 mi.)	AC121	761
Site ID: 316015 Spill Date: 2003-12-10 Spill Number/Closed Date: 0310457 / 2003-12-15				
BYRNE DAIRY	235 KING STREET	WSW 1/4 - 1/2 (0.401 mi.)	AB122	762
Site ID: 198191 Spill Date: 1986-09-16 Spill Number/Closed Date: 8603904 / 1988-01-15				
DISTRICT HEATING & C	***601 S STATE ST***	***NNW 1/4 - 1/2 (0.411 mi.)***	***AD123***	***764***
Site ID: 93875 Spill Date: 1986-07-18 Spill Number/Closed Date: 8602554 / 1988-12-12				
BYRNE DAIRY INC.	***240 ONEIDA STREET***	***W 1/4 - 1/2 (0.413 mi.)***	***125***	***777***

Site ID: 64142
Site ID: 109079
Site ID: 168673
Spill Date: 1998-07-09
Spill Date: 1997-06-11
Spill Date: 1987-12-28
Spill Number/Closed Date: 9804457 / 2000-11-08
Spill Number/Closed Date: 9703387 / 1997-06-30
Spill Number/Closed Date: 8708332 / 1988-02-04

HUTCHINGS PSYCHIATRI	BLDG 11	NNE 1/4 - 1/2 (0.420 mi.)	AE128	793
Site ID: 121287				
Spill Date: 1998-11-02				
Spill Number/Closed Date: 9809684 / 2003-10-31				
CNY CENTRO INC	***200 CORTLAND AVE***	***SW 1/4 - 1/2 (0.427 mi.)***	***AG132***	***805***
Site ID: 230780				
Site ID: 230781				
Spill Date: 1995-01-18				
Spill Date: 1995-10-11				
Spill Number/Closed Date: 9413883 / 2002-08-06				
Spill Number/Closed Date: 9508450 / 1995-10-11				
CENTRAL BUS CNYRTA M	***200 CORTLAND AVE***	***SW 1/4 - 1/2 (0.427 mi.)***	***AG133***	***819***
Site ID: 275090				
Spill Date: 1993-03-09				
Spill Number/Closed Date: 9213577 / 1995-12-28				
CATHEDRAL IMMACULATE	420 MONTGOMERY AVE	NNW 1/4 - 1/2 (0.430 mi.)	AC134	824
Site ID: 317505				
Spill Date: 1988-02-05				
Spill Number/Closed Date: 8709428 / 1988-02-05				
ATLAS SERVICES	TAYLOR ST; KING ST	W 1/4 - 1/2 (0.440 mi.)	AI136	832
Site ID: 243223				
Spill Date: 1987-11-25				
Spill Number/Closed Date: 8707432 / 1988-01-05				
PRESIDENTIAL PLAZA	90 PRESIDENTIAL PLAZ	N 1/4 - 1/2 (0.464 mi.)	AK144	874
Site ID: 297379				
Spill Date: 1989-10-12				
Spill Number/Closed Date: 8906852 / 1989-10-12				
HOTEL SYRACUSE	***500 S WARREN ST***	***NW 1/4 - 1/2 (0.464 mi.)***	***AL147***	***877***
Site ID: 295387				
Spill Date: 1998-11-11				
Spill Number/Closed Date: 9810139 / 2000-04-24				
H.S.M.PACKAGING CORP	123 LARNED ST	W 1/4 - 1/2 (0.476 mi.)	AM148	895
Site ID: 228231				
Spill Date: 1996-07-24				
Spill Number/Closed Date: 9605294 / 1996-09-30				
PRESIDENTIAL PLAZA	PRESIDENTIAL PLAZA	N 1/4 - 1/2 (0.481 mi.)	AK151	901
Site ID: 250694				
Spill Date: 1994-07-08				
Spill Number/Closed Date: 9407228 / 2002-08-06				
NYS ARMORY JEFFERSON	JEFFERSON ST. ARMORY	NNW 1/4 - 1/2 (0.488 mi.)	153	904
Site ID: 114453				
Spill Date: 1991-12-19				

Spill Number/Closed Date: 9110102 / 1992-01-08

Lists of state and tribal registered storage tanks

NY UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the NY UST list, as provided by EDR, has revealed that there are 9 NY UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE UNIVERSITY	***500 EAST TAYLOR ST***	***SE 0 - 1/8 (0.012 mi.)***	***B15***	***139***
Database: UST, Date of Government Version: 03/17/2025				

Lower Elevation	Address	Direction / Distance	Map ID	Page
NY1-1 PIONEER HOMES	ADAMS/RENWICK/TAYLOR	NW 0 - 1/8 (0.079 mi.)	E26	233
Database: UST, Date of Government Version: 03/17/2025				
THE SALVATION ARMY	1105 S. STATE ST	WSW 0 - 1/8 (0.097 mi.)	C32	298
Database: UST, Date of Government Version: 03/17/2025				
FORMER SALVATION ARM	1117 SOUTH STATE ST	WSW 0 - 1/8 (0.099 mi.)	G38	306
Database: UST, Date of Government Version: 03/17/2025				
CENTRAL VILLAGE HOUS	302 BURT ST	SW 0 - 1/8 (0.104 mi.)	H40	311
Database: UST, Date of Government Version: 03/17/2025				
SYRACUSE POLICE DEPT	916 S STATE ST	NW 1/8 - 1/4 (0.160 mi.)	J56	406
Database: UST, Date of Government Version: 03/17/2025				
FIRE STATION #1	900 SOUTH STATE ST	NW 1/8 - 1/4 (0.174 mi.)	J61	442
Database: UST, Date of Government Version: 03/17/2025				
WAREHOUSE	908 MONTGOMERY ST	WSW 1/8 - 1/4 (0.186 mi.)	L65	452
Database: UST, Date of Government Version: 03/17/2025				
CENTRAL TECH VOCATIO	258 EAST ADAMS ST	NW 1/8 - 1/4 (0.236 mi.)	Q79	501
Database: UST, Date of Government Version: 03/17/2025				

NY CBS: These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

A review of the NY CBS list, as provided by EDR, and dated 03/17/2025 has revealed that there are 2 NY CBS sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SU CHILLED WATER PLA	***500 E. TAYLOR STREET***	***SE 0 - 1/8 (0.012 mi.)***	***B17***	***151***
Facility Status: Unregulated/Closed CBS Number: 7-000152 CBS Number: 7-000281				
PROJECT ORANGE	***520 E TAYLOR ST***	***ESE 0 - 1/8 (0.092 mi.)***	***F27***	***235***
Facility Status: Unregulated/Closed				

EXECUTIVE SUMMARY

CBS Number: 7-000230

NY AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the NY AST list, as provided by EDR, has revealed that there are 6 NY AST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SU CHILLED WATER PLA	***500 E. TAYLOR STREET***	***SE 0 - 1/8 (0.012 mi.)***	***B13***	***43***
Database: AST, Date of Government Version: 03/17/2025 Facility Id: 7-000281				
SYRACUSE UNIVERSITY	***500 EAST TAYLOR ST***	***SE 0 - 1/8 (0.012 mi.)***	***B15***	***139***
Database: AST, Date of Government Version: 03/17/2025 Facility Id: 7-180602				
SU CHILLED WATER PLA	***500 E. TAYLOR STREET***	***SE 0 - 1/8 (0.012 mi.)***	***B17***	***151***
Database: AST, Date of Government Version: 03/17/2025 Facility Id: 7-000152				
PROJECT ORANGE	***520 E TAYLOR ST***	***ESE 0 - 1/8 (0.092 mi.)***	***F27***	***235***
Database: AST, Date of Government Version: 03/17/2025 Facility Id: 7-000230				

Lower Elevation	Address	Direction / Distance	Map ID	Page
FIRE STATION #1	900 SOUTH STATE ST	NW 1/8 - 1/4 (0.174 mi.)	J63	446
Database: AST, Date of Government Version: 03/17/2025 Facility Id: 7-181935				
NY1-1 PIONEER HOMES	ADAMS/RENWICK/TAYLOR	NW 1/8 - 1/4 (0.199 mi.)	M66	455
Database: AST, Date of Government Version: 03/17/2025 Facility Id: 7-498947				

NY CBS AST: Chemical Bulk Storage Database. Registration data collected as required by 6 NYCRR Part 596. It includes facilities storing hazardous substances listed in 6 NYCRR Part 597, in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size. Includes facilities registered (and closed) since effective date of CBS regulations (July 15, 1988) through the date request is processed.

A review of the NY CBS AST list, as provided by EDR, and dated 01/01/2002 has revealed that there are 3 NY CBS AST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SU CHILLED WATER PLA	***500 E. TAYLOR STREET***	***SE 0 - 1/8 (0.012 mi.)***	***B13***	***43***
Facility Status: 2 Facility Status: 1 CBS Number: 7-000281				
SYRACUSE UNIVERSITY	500 E. TAYLOR STREET	SE 0 - 1/8 (0.012 mi.)	B16	147
Facility Status: 1 Facility Status: 1 CBS Number: 7-000152				
PROJECT ORANGE	***520 E TAYLOR ST***	***ESE 0 - 1/8 (0.092 mi.)***	***F27***	***235***

Facility Status: 1
Facility Status: 1
CBS Number: 7-000230

State and tribal institutional control / engineering control registries

NY ENG CONTROLS: Environmental Remediation sites that have engineering controls in place.

A review of the NY ENG CONTROLS list, as provided by EDR, and dated 02/03/2025 has revealed that there are 2 NY ENG CONTROLS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MCKINNEY PROPERTY Site Code: 57334	***1226 SOUTH MCBRIDE S***	***SSE 0 - 1/8 (0.056 mi.)***	***D22***	***174***

Lower Elevation	Address	Direction / Distance	Map ID	Page
FORMER COYNE TEXTILE Site Code: 507968	***140 CORTLAND AVENUE***	***WSW 1/4 - 1/2 (0.299 mi.)***	***V96***	***577***

Environmental Remediation sites that have institutional controls in place.

A review of the NY INST CONTROL list, as provided by EDR, and dated 02/03/2025 has revealed that there are 2 NY INST CONTROL sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MCKINNEY PROPERTY Site Code: 57334	***1226 SOUTH MCBRIDE S***	***SSE 0 - 1/8 (0.056 mi.)***	***D22***	***174***

Lower Elevation	Address	Direction / Distance	Map ID	Page
FORMER COYNE TEXTILE Site Code: 507968	***140 CORTLAND AVENUE***	***WSW 1/4 - 1/2 (0.299 mi.)***	***V96***	***577***

Lists of state and tribal brownfield sites

NY BROWNFIELDS: Brownfields Site List

A review of the NY BROWNFIELDS list, as provided by EDR, and dated 02/03/2025 has revealed that there are 8 NY BROWNFIELDS sites within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
EAST ADAMS REDEVELOP Site Code: 659420	***1105-1117 SOUTH STAT***	***WSW 0 - 1/8 (0.097 mi.)***	***C31***	***291***
EAST ADAMS REDEVELOP Site Code: 657340	300 BURT STREET	SW 0 - 1/8 (0.105 mi.)	H42	315
EAST ADAMS REDEVELOP	100 ANGELOU TERRACE	NW 1/8 - 1/4 (0.153 mi.)	J52	372

Site Code: 658151				
SOUTH SALINA STREET Site Code: 570636	***1081 SOUTH SALINA ST***	***SW 1/4 - 1/2 (0.276 mi.)***	***R88***	***537***
FORMER COYNE TEXTILE Site Code: 507968	***140 CORTLAND AVENUE***	***WSW 1/4 - 1/2 (0.299 mi.)***	***V96***	***577***
RENALLI TAYLOR ST LL Site Code: 580830	***140 CORTLAND AVE***	***WSW 1/4 - 1/2 (0.299 mi.)***	***V97***	***638***
JMA CAMPUS PLAN Site Code: 667687	623 ONEIDA STREET	WSW 1/4 - 1/2 (0.393 mi.)	119	758
CHIMES BUILDING Site Code: 662655	500-550 SOUTH SALINA	WNW 1/4 - 1/2 (0.425 mi.)	AF130	795

NY ERP: In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a $200 million Environmental Restoration or Brownfields Fund as part of the $1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

A review of the NY ERP list, as provided by EDR, and dated 02/03/2025 has revealed that there is 1 NY ERP site within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MCKINNEY PROPERTY Site Code: 57334	***1226 SOUTH MCBRIDE S***	***SSE 0 - 1/8 (0.056 mi.)***	***D22***	***174***

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: The EPA's listing of Brownfields properties from the Cleanups in My Community program, which provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

A review of the US BROWNFIELDS list, as provided by EDR, and dated 09/09/2024 has revealed that there are 15 US BROWNFIELDS sites within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
1210 S STATE ST	***1210 S STATE ST***	***SW 1/8 - 1/4 (0.154 mi.)***	***K53***	***375***
1212 S STATE ST	***1212 S STATE ST***	***SW 1/8 - 1/4 (0.159 mi.)***	***K55***	***393***
1214 S STATE ST	***1214 S STATE ST***	***SW 1/8 - 1/4 (0.163 mi.)***	***K58***	***410***
917 MONTGOMERY STREE	***917 MONTGOMERY STREE***	***WSW 1/8 - 1/4 (0.167 mi.)***	***L59***	***423***
1045-1047 SOUTH SALI	***1045 SOUTH SALINA ST***	***SW 1/4 - 1/2 (0.251 mi.)***	***O84***	***527***
1049-1071 SOUTH SALI	***1049-1071 SOUTH SALI***	***SW 1/4 - 1/2 (0.261 mi.)***	***O85***	***530***
1073-1079 SOUTH SALI	***1073-1079 SOUTH SALI***	***SW 1/4 - 1/2 (0.272 mi.)***	***R86***	***532***
1081-1085 SOUTH SALI	***1081-1085 SOUTH SALI***	***SW 1/4 - 1/2 (0.276 mi.)***	***R87***	***535***
1101-1111 SOUTH SALI	***1101-1111 SOUTH SALI***	***SW 1/4 - 1/2 (0.277 mi.)***	***R89***	***544***
1202-04 SOUTH SALINA	***1202-04 SOUTH SALINA***	***SW 1/4 - 1/2 (0.362 mi.)***	***X112***	***714***

EXECUTIVE SUMMARY

Lower Elevation	Address	Direction / Distance	Map ID	Page
1146 S SALINA STREET	***1146 S SALINA STREET***	***SW 1/4 - 1/2 (0.366 mi.)***	***X113***	***721***
1208-18 SOUTH SALINA	***1208-18 SOUTH SALINA***	***SW 1/4 - 1/2 (0.376 mi.)***	***115***	***737***
THE CHIMES BUILDING	500-550 SOUTH SALINA	WNW 1/4 - 1/2 (0.425 mi.)	AF131	798
1357 SALINA STREET S	***1357 SALINA STREET S***	***SSW 1/4 - 1/2 (0.436 mi.)***	***AH135***	***825***
1400-20 SALINA STREE	***1400-20 SALINA STREE***	***SSW 1/4 - 1/2 (0.477 mi.)***	***AH150***	***897***

Records of Emergency Release Reports

NY Spills: Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, and dated 02/02/2025 has revealed that there are 18 NY Spills sites within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
PARKING LOT- 111 RAD Spill Number/Closed Date: 2005041 / 2022-05-13 Site ID: 610813 Spill Date: 2020-09-01	111 RADISON CT	0 - 1/8 (0.001 mi.)	A3	13
INTERSECTION OF Spill Number/Closed Date: 0600689 / 2006-04-19 Site ID: 362754 Spill Date: 2006-04-18	EAST TAYLOR/SOUTH MC	SE 0 - 1/8 (0.004 mi.)	B5	17
STEAM HEAT SYR. UNIV Spill Number/Closed Date: 8801654 / 1995-02-09 Site ID: 257809 Spill Date: 1988-05-23	TALOR & MCBRIDE ST	SE 0 - 1/8 (0.007 mi.)	B6	18
E. TAYLOR AND MCBRID Spill Number/Closed Date: 9204042 / 1992-07-08 Site ID: 238382 Spill Date: 1992-07-08	EAST TAYLOR AND MCBR	SE 0 - 1/8 (0.007 mi.)	B7	19
TAYLOR & MCBRIDE ST. Spill Number/Closed Date: 9107234 / 1991-11-12 Site ID: 284835 Spill Date: 1991-10-05	TAYLOR AND MCBRIDE S	SE 0 - 1/8 (0.007 mi.)	B8	20
SYRACUSE UNIV STEAM Spill Number/Closed Date: 1502394 / 2016-04-08 Site ID: 508657 Spill Date: 2015-06-03	500 EAST TAYLOR ST	SE 0 - 1/8 (0.012 mi.)	B9	21
STEAM STATION Spill Number/Closed Date: 1810736 / 2019-03-26 Site ID: 581643 Spill Date: 2019-01-23	500 EAST TAYLOR ST	SE 0 - 1/8 (0.012 mi.)	B11	25
SYRACUSE UNIVERSITY Spill Number/Closed Date: 0407665 / 2004-10-13 Spill Number/Closed Date: 8910992 / 1990-07-09 Spill Number/Closed Date: 1206833 / 2012-12-04	***500 E TAYLOR ST***	***SE 0 - 1/8 (0.012 mi.)***	***B14***	***46***

Site ID: 332190
Site ID: 161895
Site ID: 469851
Spill Date: 2004-10-11
Spill Date: 1990-02-17
Spill Date: 2012-10-11

SU CHILLED WATER PLA ***500 E. TAYLOR STREET*** ***SE 0 - 1/8 (0.012 mi.)*** ***B17*** ***151***
Spill Number/Closed Date: 1902943 / 2020-03-27
Spill Number/Closed Date: 9008107 / 1990-10-24
Site ID: 590889
Site ID: 161896
Spill Date: 2019-06-21
Spill Date: 1990-10-24

PROJECT ORANGE OLD S.U. STEAM PLANT ESE 0 - 1/8 (0.026 mi.) B18 165
Spill Number/Closed Date: 9207607 / 1992-09-30
Site ID: 262415
Spill Date: 1992-09-29

ERP SITE 1226 MCBRIDE ST SSE 0 - 1/8 (0.056 mi.) D21 173
Spill Number/Closed Date: 2308014 / Not Reported
Site ID: 661110
Spill Date: 2023-12-28

MCKINNEY PROPERTY ***1226 SOUTH MCBRIDE S*** ***SSE 0 - 1/8 (0.056 mi.)*** ***D22*** ***174***
Spill Number/Closed Date: 0402274 / 2004-06-04
Spill Number/Closed Date: 0712291 / 2009-02-10
Site ID: 202067
Site ID: 393888
Spill Date: 2004-05-31
Spill Date: 2008-02-21

PROJECT ORANGE ***520 E TAYLOR ST*** ***ESE 0 - 1/8 (0.092 mi.)*** ***F27*** ***235***
Spill Number/Closed Date: 0001904 / 2002-06-03
Spill Number/Closed Date: 1213761 / 2013-01-09
Spill Number/Closed Date: 9211857 / 1993-03-02
Site ID: 223336
Site ID: 476969
Site ID: 212315
Spill Date: 2000-05-15
Spill Date: 2012-12-20
Spill Date: 1993-01-16

SU STEAM STATION 550 E TAYLOR ST ESE 0 - 1/8 (0.105 mi.) F41 313
Spill Number/Closed Date: 8912216 / 1990-04-04
Site ID: 133848
Spill Date: 1990-03-23

Lower Elevation	Address	Direction / Distance	Map ID	Page

CITY OWNED APARTMENT 301-311 EAST TAYLOR WSW 0 - 1/8 (0.054 mi.) C20 172
Spill Number/Closed Date: 2400040 / Not Reported
Site ID: 664372
Spill Date: 2024-04-02

ONONDAGA PLAZA LINCOLN CENTER NW 0 - 1/8 (0.073 mi.) E24 230
Spill Number/Closed Date: 9405994 / 1994-08-02
Site ID: 218180

Spill Date: 1994-08-02

SPILL NUMBER 8601904 Spill Number/Closed Date: 8601904 / 1987-08-11 Site ID: 142087 Spill Date: 1986-06-19	1105 SOUTH STATE ST	WSW 0 - 1/8 (0.097 mi.)	C34	301
FORMER SALVATION ARM Spill Number/Closed Date: 9711143 / 2002-08-06 Site ID: 61011 Spill Date: 1998-01-05	***1105 SOUTH STATE ST***	***WSW 0 - 1/8 (0.097 mi.)***	***C35***	***302***

Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 06/02/2025 has revealed that there are 11 RCRA NonGen / NLR sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE UNIVERSITY EPA ID:: NYD982271918	***500 E TAYLOR ST***	***SE 0 - 1/8 (0.012 mi.)***	***B12***	***26***
MC BRIDE SUB EPA ID:: NYD980782775	***S MCBRIDE***	***SE 0 - 1/8 (0.045 mi.)***	***B19***	***166***
PROJECT ORANGE EPA ID:: NYD987016136	***520 E TAYLOR ST***	***ESE 0 - 1/8 (0.092 mi.)***	***F27***	***235***
NYSDOT BIN 1031569 EPA ID:: NY0000202481	***I-81/EAST ADAMS STRE***	***E 0 - 1/8 (0.106 mi.)***	***F43***	***317***
SYRACUSE HOUSING AUT EPA ID:: NYD981873599	***516 BURT ST***	***SE 0 - 1/8 (0.112 mi.)***	***45***	***326***
NYSDOT BIN 7706370 - EPA ID:: NYR000229765	***522 RENWICK AVE***	***SE 1/8 - 1/4 (0.205 mi.)***	***N70***	***461***
SYRACUSE UNIVERSITY EPA ID:: NYD986947505	***401 VAN BUREN ST***	***SE 1/8 - 1/4 (0.217 mi.)***	***72***	***466***

Lower Elevation	Address	Direction / Distance	Map ID	Page
NIAGARA MOHAWK - A N EPA ID:: NYP000976662	***900 SOUTH STATE ST***	***NW 1/8 - 1/4 (0.174 mi.)***	***J64***	***448***
INSTITUTE OF TECHNOL EPA ID:: NYD986981520	***258 E ADAMS ST***	***NW 1/8 - 1/4 (0.236 mi.)***	***Q78***	***487***
TRIPP KATIE EPA ID:: NYR000056853	***1429 S MCBRIDE ST***	***SSE 1/8 - 1/4 (0.243 mi.)***	***81***	***509***
ONONDAGA CO CONVENTI EPA ID:: NYD986937431	***S STATE ST***	***NNW 1/8 - 1/4 (0.245 mi.)***	***M82***	***513***

EXECUTIVE SUMMARY

FINDS: The Facility Index System contains both facility information and "pointers" to other sources of information that contain more detail. These include: RCRIS; Permit Compliance System (PCS); Aerometric Information Retrieval System (AIRS); FATES (FIFRA [Federal Insecticide Fungicide Rodenticide Act] and TSCA Enforcement System, FTTS [FIFRA/TSCA Tracking System]; CERCLIS; DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes); Federal Underground Injection Control (FURS); Federal Reporting Data System (FRDS); Surface Impoundments (SIA); TSCA Chemicals in Commerce Information System (CICS); PADS; RCRA-J (medical waste transporters/disposers); TRIS; and TSCA. The source of this database is the U.S. EPA/NTIS.

A review of the FINDS list, as provided by EDR, and dated 04/22/2025 has revealed that there is 1 FINDS site within approximately 0.001 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT	***116-118 RADISSON COU***	***0 - 1/8 (0.000 mi.)***	***A1***	***9***
Registry ID:: 110033157232				

ECHO: ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

A review of the ECHO list, as provided by EDR, and dated 12/21/2024 has revealed that there is 1 ECHO site within approximately 0.001 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT	***116-118 RADISSON COU***	***0 - 1/8 (0.000 mi.)***	***A1***	***9***
Registry ID: 110033157232				

PFAS ECHO: Regulators and the public have expressed interest in knowing which regulated entities may be using PFAS. EPA has developed a dataset from various sources that show which industries may be handling PFAS. Approximately 120,000 facilities subject to federal environmental programs have operated or currently operate in industry sectors with processes that may involve handling and/or release of PFAS.

A review of the PFAS ECHO list, as provided by EDR, and dated 03/24/2025 has revealed that there is 1 PFAS ECHO site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SUNY HEALTH SCIENCE		NE 1/8 - 1/4 (0.215 mi.)	71	465

UST FINDER RELEASE: US EPA's UST Finder data is a national composite of leaking underground storage tanks. This data contains information about, and locations of, leaking underground storage tanks. Data was collected from state sources and standardized into a national profile by EPA's Office of Underground Storage Tanks, Office of Research and Development, and the Association of State and Territorial Solid Waste Management Officials.

A review of the UST FINDER RELEASE list, as provided by EDR, and dated 06/08/2023 has revealed that there are 20 UST FINDER RELEASE sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
V.A. MEDICAL CENTER	800 IRIVING AVENUE	ESE 1/4 - 1/2 (0.288 mi.)	T93	555
743 IRVING AVE.	743 IRVING AVE	ENE 1/4 - 1/2 (0.325 mi.)	Y106	708
CASTLE REST NURSE HO	401 E CASTLE ST	S 1/4 - 1/2 (0.360 mi.)	Z111	713
SPILL NUMBER 9900884	116 EAST CASTLE ST	SSW 1/4 - 1/2 (0.443 mi.)	AJ138	835

EXECUTIVE SUMMARY

Lower Elevation	Address	Direction / Distance	Map ID	Page
FORMER SALVATION ARM	1105 SOUTH STATE ST	WSW 0 - 1/8 (0.097 mi.)	C30	290
SALVATION ARMY	1105 SOUTH STATE ST	WSW 0 - 1/8 (0.097 mi.)	C33	301
ADAMS & STATE ST. GA	ADAMS & STATE STREET	NW 1/8 - 1/4 (0.202 mi.)	M68	459
DESIMONES SERVICE ST	680 S. SALINA ST	WNW 1/4 - 1/2 (0.281 mi.)	S91	552
MONDO'S AGWAY	1127 SO. SALINA ST	SW 1/4 - 1/2 (0.320 mi.)	X100	692
MONDO'S SERVICE STAT	1133 SOUTH SALINA	SW 1/4 - 1/2 (0.324 mi.)	X104	706
HARRISON CONVENTION	HARRISON & MONTGOMER	NW 1/4 - 1/2 (0.326 mi.)	107	709
HARRISON PARKING GAR	WARREN & HARRISON ST	NW 1/4 - 1/2 (0.390 mi.)	AA118	757
STEAM STATION-S.STAT	601 S. STATE ST	NNW 1/4 - 1/2 (0.411 mi.)	AD124	777
HUTCHINGS	500 CEDAR ST	NNE 1/4 - 1/2 (0.416 mi.)	AE126	790
500 SOUTH SALINA STR	500 SOUTH SALINA STR	WNW 1/4 - 1/2 (0.425 mi.)	AF129	794
COUNTY SEWER ROW	CLINTON AND WEST ONO	WNW 1/4 - 1/2 (0.455 mi.)	AF141	872
ATLAS LINEN	320 WEST TAYLOR ST	WSW 1/4 - 1/2 (0.461 mi.)	AI143	874
PRESIDENTIAL PLAZA	90 PRESIDENTIAL PLAZ	N 1/4 - 1/2 (0.464 mi.)	AK145	876
500 WARREN ST	500 WARREN ST	NW 1/4 - 1/2 (0.464 mi.)	AL146	876
H.S.M.PACKAGING CORP	123 LARNED ST	W 1/4 - 1/2 (0.476 mi.)	AM149	896

UST FINDER: EPA developed UST Finder, a web map application containing a comprehensive, state-sourced national map of underground storage tank (UST) and leaking UST (LUST) data. It provides the attributes and locations of active and closed USTs, UST facilities, and LUST sites from states and from Tribal lands and US territories . UST Finder contains information about proximity of UST facilities and LUST sites to: surface and groundwater public drinking water protection areas; estimated number of private domestic wells and number of people living nearby; and flooding and wildfires.

A review of the UST FINDER list, as provided by EDR, and dated 06/08/2023 has revealed that there are 6 UST FINDER sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE UNIVERSITY	500 EAST TAYLOR ST	SE 0 - 1/8 (0.012 mi.)	B10	23

Lower Elevation	Address	Direction / Distance	Map ID	Page
THE SALVATION ARMY	1105 S. STATE ST	WSW 0 - 1/8 (0.097 mi.)	C29	289
CENTRAL VILLAGE HOUS	302 BURT ST	SW 0 - 1/8 (0.104 mi.)	H39	310
SYRACUSE POLICE DEPT	916 S STATE ST	NW 1/8 - 1/4 (0.160 mi.)	J57	409
FIRE STATION #1	900 SOUTH STATE ST	NW 1/8 - 1/4 (0.174 mi.)	J62	445
CENTRAL TECH	285 E. ADAMS ST	NW 1/8 - 1/4 (0.229 mi.)	M76	485

E MANIFEST: EPA established a national system for tracking hazardous waste shipments electronically. This system, known as ?e-Manifest,? will modernize the nation?s cradle-to-grave hazardous waste tracking process while saving valuable time, resources, and dollars for industry and states.

A review of the E MANIFEST list, as provided by EDR, and dated 02/17/2025 has revealed that there are 4 E MANIFEST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE UNIVERSITY	***500 E TAYLOR ST***	***SE 0 - 1/8 (0.012 mi.)***	***B12***	***26***
SYRACUSE HOUSING AUT	***1207 ALMOND ST***	***ESE 0 - 1/8 (0.114 mi.)***	***F46***	***336***
SYRACUSE UNIVERSITY	***401 VAN BUREN ST***	***SE 1/8 - 1/4 (0.217 mi.)***	***72***	***466***

Lower Elevation	Address	Direction / Distance	Map ID	Page
NIAGARA MOHAWK - A N	***900 SOUTH STATE ST***	***NW 1/8 - 1/4 (0.174 mi.)***	***J64***	***448***

EXECUTIVE SUMMARY

NY PFAS: DEC surveyed select businesses, fire departments, fire training centers, bulk storage facilities, airports, and Department of Defense (DoD) facilities. The responses to the survey have helped to determine if these entities used or stored materials containing PFOA/PFOS including AFFF and dispersants used in Teflon coating operations. The results of this survey will be updated periodically as additional responses are received..

A review of the NY PFAS list, as provided by EDR, has revealed that there is 1 NY PFAS site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
EAST ADAMS REDEVELOP	***1105-1117 SOUTH STAT***	***WSW 0 - 1/8 (0.097 mi.)***	***C31***	***291***
Database: PFAS 3, Date of Government Version: 02/03/2025				

NY MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the NY MANIFEST list, as provided by EDR, and dated 12/31/2019 has revealed that there are 19 NY MANIFEST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SU CHILLED WATER PLA	***500 E. TAYLOR STREET***	***SE 0 - 1/8 (0.012 mi.)***	***B17***	***151***
EPA ID: NYD982271918				
MC BRIDE SUB	***S MCBRIDE***	***SE 0 - 1/8 (0.045 mi.)***	***B19***	***166***
EPA ID: NYD980782775				
PROJECT ORANGE	***520 E TAYLOR ST***	***ESE 0 - 1/8 (0.092 mi.)***	***F27***	***235***
EPA ID: NYD987016136				
NYSDOT BIN 1031569	***I-81/EAST ADAMS STRE***	***E 0 - 1/8 (0.106 mi.)***	***F43***	***317***
EPA ID: NY0000202481				
SYRACUSE HOUSING AUT	***516 BURT ST***	***SE 0 - 1/8 (0.112 mi.)***	***45***	***326***
EPA ID: NYD981873599				
SYRACUSE HOUSING AUT	***1207 ALMOND ST***	***ESE 0 - 1/8 (0.114 mi.)***	***F46***	***336***
EPA ID: NYR000154468				
NYSDOT BIN 7706370 -	522 RENWICK AVE	SE 1/8 - 1/4 (0.205 mi.)	N69	460
EPA ID: NYR000229765				
SYRACUSE UNIVERSITY	***401 VAN BUREN ST***	***SE 1/8 - 1/4 (0.217 mi.)***	***72***	***466***
EPA ID: NYD986947505				

Lower Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT	***116-118 RADISSON COU***	***0 - 1/8 (0.000 mi.)***	***A2***	***9***
EPA ID: NYR000154476				
SYRACUSE HOUSING AUT	***409 BURT ST***	***S 0 - 1/8 (0.069 mi.)***	***D23***	***218***
EPA ID: NY0000201889				
NIAGARA MOHAWK POWER	***235 OAKWOOD AVE. EXT***	***SSW 1/8 - 1/4 (0.131 mi.)***	***48***	***343***
EPA ID: NYD980788442				
SYRACUSE HOUSING AUT	***218 NEW ST***	***WNW 1/8 - 1/4 (0.135 mi.)***	***I49***	***367***
EPA ID: NYR000171124				
SYRACUSE HOUSING AUT	***120-122 TYLER COURT***	***NNE 1/8 - 1/4 (0.159 mi.)***	***54***	***388***
EPA ID: NYR000154492				
NIAGARA MOHAWK A NAT	900 SOUTH STATE STRE	NW 1/8 - 1/4 (0.174 mi.)	J60	441

EPA ID: NYP000976662				
FAMILY DOLLAR #5071 EPA ID: NYR000211730	945 S SALINA ST	WSW 1/8 - 1/4 (0.228 mi.)	P74	479
INSTITUTE OF TECHNOL EPA ID: NYD986981520	***258 E ADAMS ST***	***NW 1/8 - 1/4 (0.236 mi.)***	***Q78***	***487***
TRIPP KATIE EPA ID: NYR000056853	***1429 S MCBRIDE ST***	***SSE 1/8 - 1/4 (0.243 mi.)***	***81***	***509***
ONONDAGA CO CONVENTI EPA ID: NYD986937431	***S STATE ST***	***NNW 1/8 - 1/4 (0.245 mi.)***	***M82***	***513***
SYRACUSE COMMUNITY H EPA ID: NYR000199190	***930 S SALINA ST***	***WSW 1/8 - 1/4 (0.249 mi.)***	***P83***	***520***

PA MANIFEST: Hazardous waste manifest information.

A review of the PA MANIFEST list, as provided by EDR, and dated 06/30/2018 has revealed that there are 4 PA MANIFEST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT Generator EPA Id: NY0000201889	BURT & MCBRIDE ST	SSE 0 - 1/8 (0.078 mi.)	D25	231
SYRACUSE HOUSING AUT Generator EPA Id: NYR000154468	1207 ALMOND STREET	ESE 0 - 1/8 (0.114 mi.)	F47	343

Lower Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE HOUSING AUT Generator EPA Id: NYR000171124	218 NEW STREET	WNW 1/8 - 1/4 (0.135 mi.)	I50	370
SYRACUSE CITY SCHOOL Generator EPA Id: NYD986981520	258 E ADAMS ST	NW 1/8 - 1/4 (0.236 mi.)	Q80	503

NJ MANIFEST: Hazardous waste manifest information.

A review of the NJ MANIFEST list, as provided by EDR, and dated 12/31/2018 has revealed that there is 1 NJ MANIFEST site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SYRACUSE UNIVERSITY EPA Id: NYD982271918	***500 E TAYLOR ST***	***SE 0 - 1/8 (0.012 mi.)***	***B12***	***26***

NY MGP: From the late 1800's to the mid 1900's, hundreds of manufactured gas plants across New York State supplied homes and industry with fuel for heating, cooking, and lighting. Today, the New York State DEC is overseeing the investigation and cleanup of contamination left behind from these plants.

A review of the NY MGP list, as provided by EDR, and dated 02/28/2025 has revealed that there is 1 NY MGP site within approximately 1 mile of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
NM - SYRACUSE ERIE B	***300 ERIE BLVD WEST***	***NW 1/2 - 1 (0.939 mi.)***	***157***	***942***

EXECUTIVE SUMMARY

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

A review of the EDR MGP list, as provided by EDR, has revealed that there is 1 EDR MGP site within approximately 1 mile of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
NIMO - SYRACUSE - ER	300 ERIC BLVD WEST	NW 1/2 - 1 (0.902 mi.)	156	942

EDR Hist Auto: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Auto list, as provided by EDR, has revealed that there is 1 EDR Hist Auto site within approximately 0.125 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
DI PINO ANTHONY	1117 SOUTH STATE ST	WSW 0 - 1/8 (0.099 mi.)	G37	306

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 5 records.

Site Name	Database(s)
ROTONDO WAREHOUSE	NY SHWS, NY HSWDS
SIDA PROPERTIES	NY SHWS
OLD TIP-TOP BAKERY	NY SHWS
W.JEFFERSON ST. ROADWAY&ROW(400 OF	NY VCP, NY BROWNFIELDS
FORM. DUPLI GRAPHICS FACILITY(400	NY VCP, NY BROWNFIELDS

OVERVIEW MAP - 8026566.2S

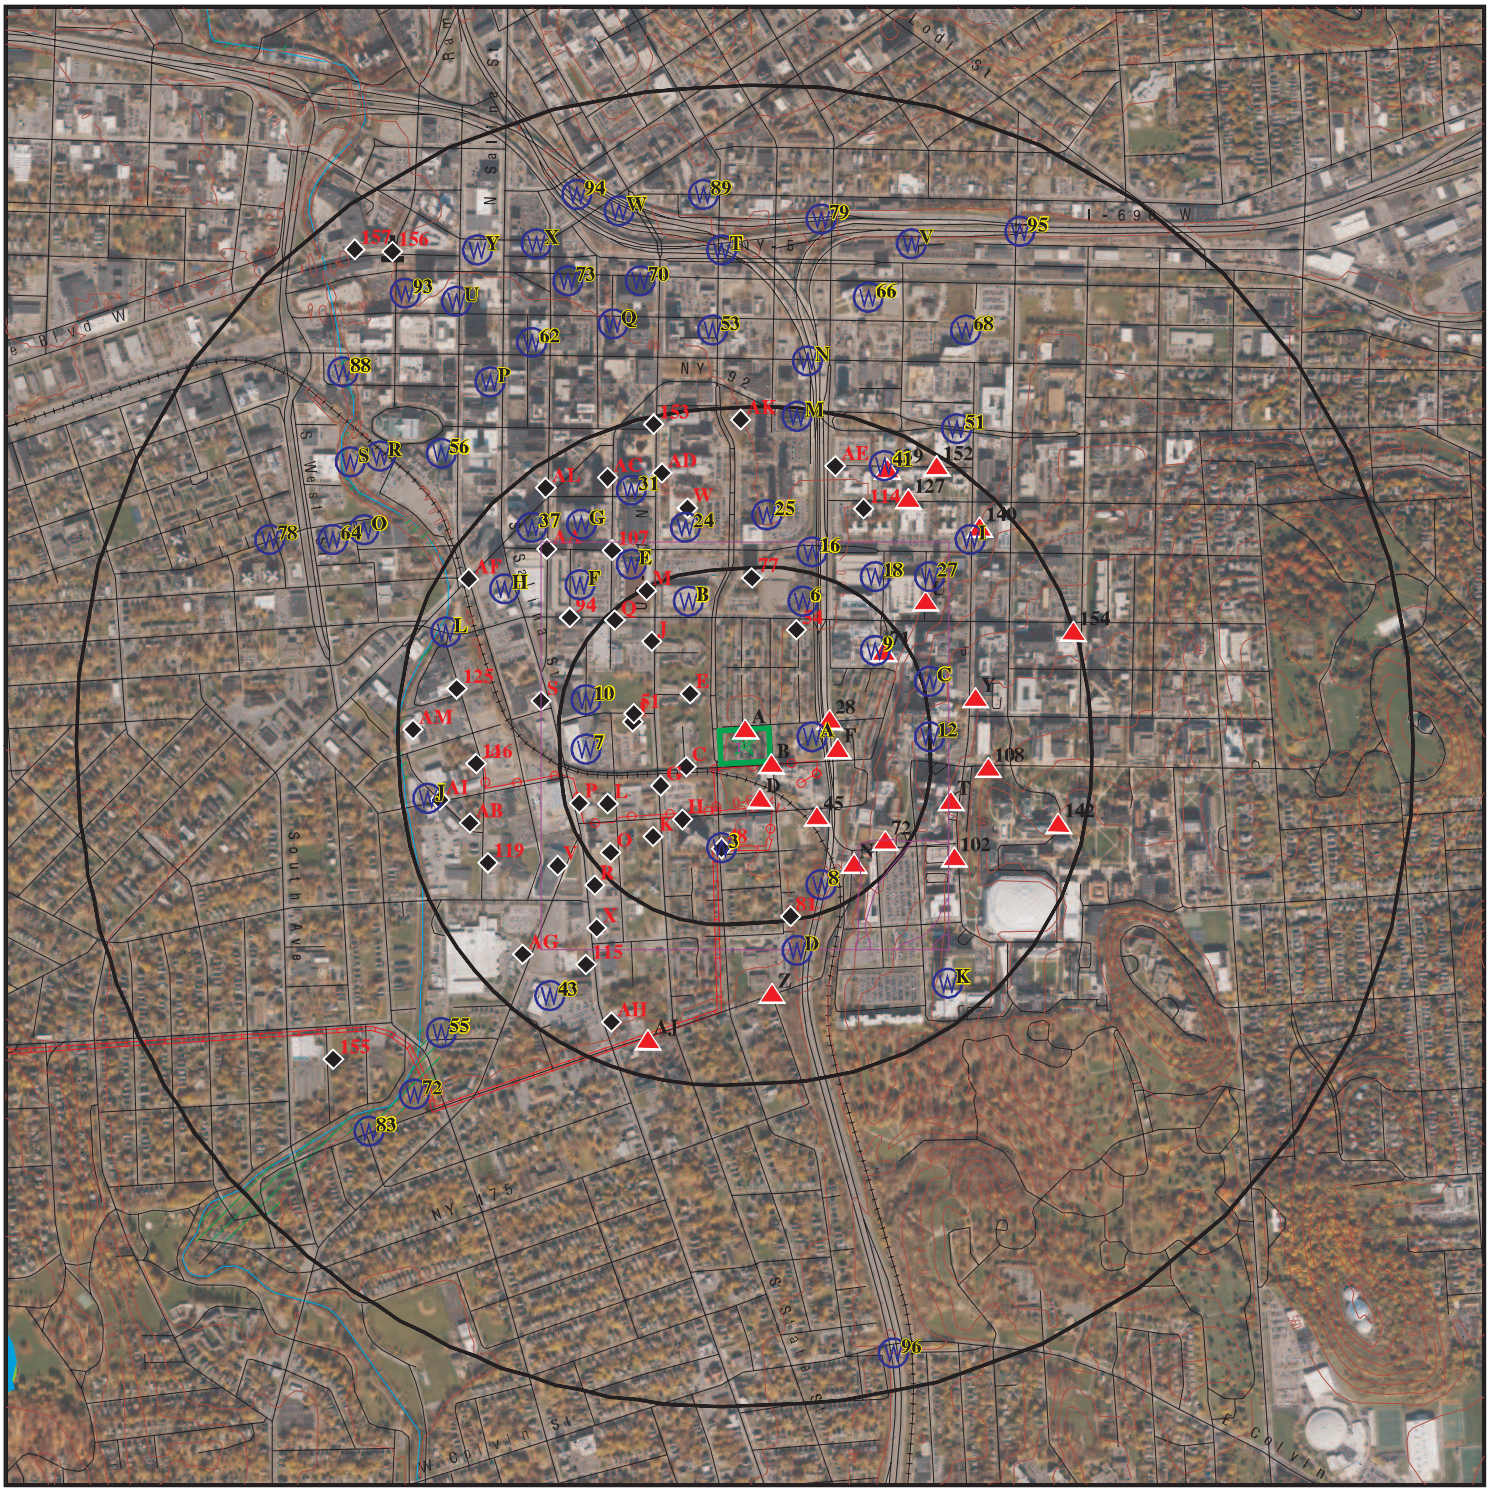

0 1/4 1/2 1 Miles

- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- National Priority List Sites
- Dept. Defense Sites
- Indian Reservations BIA
- Power transmission lines
- Pipelines
- Special Flood Hazard Area (1%)
- 0.2% Annual Chance Flood Hazard
- National Wetland Inventory
- State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME:	East Adams Redevelopment - Phase 6 Area	CLIENT:	Langan
ADDRESS:	100 Raddison Court Syracuse NY 13202	CONTACT:	Lexi Haley
LAT/LONG:	43.039903 / 76.144788	INQUIRY #:	8026566.2s
		DATE:	June 23, 2025 11:25 am

Copyright © 2025 EDR, Inc. © 2015 TomTom Rel. 2015.

DETAIL MAP - 8026566.2S

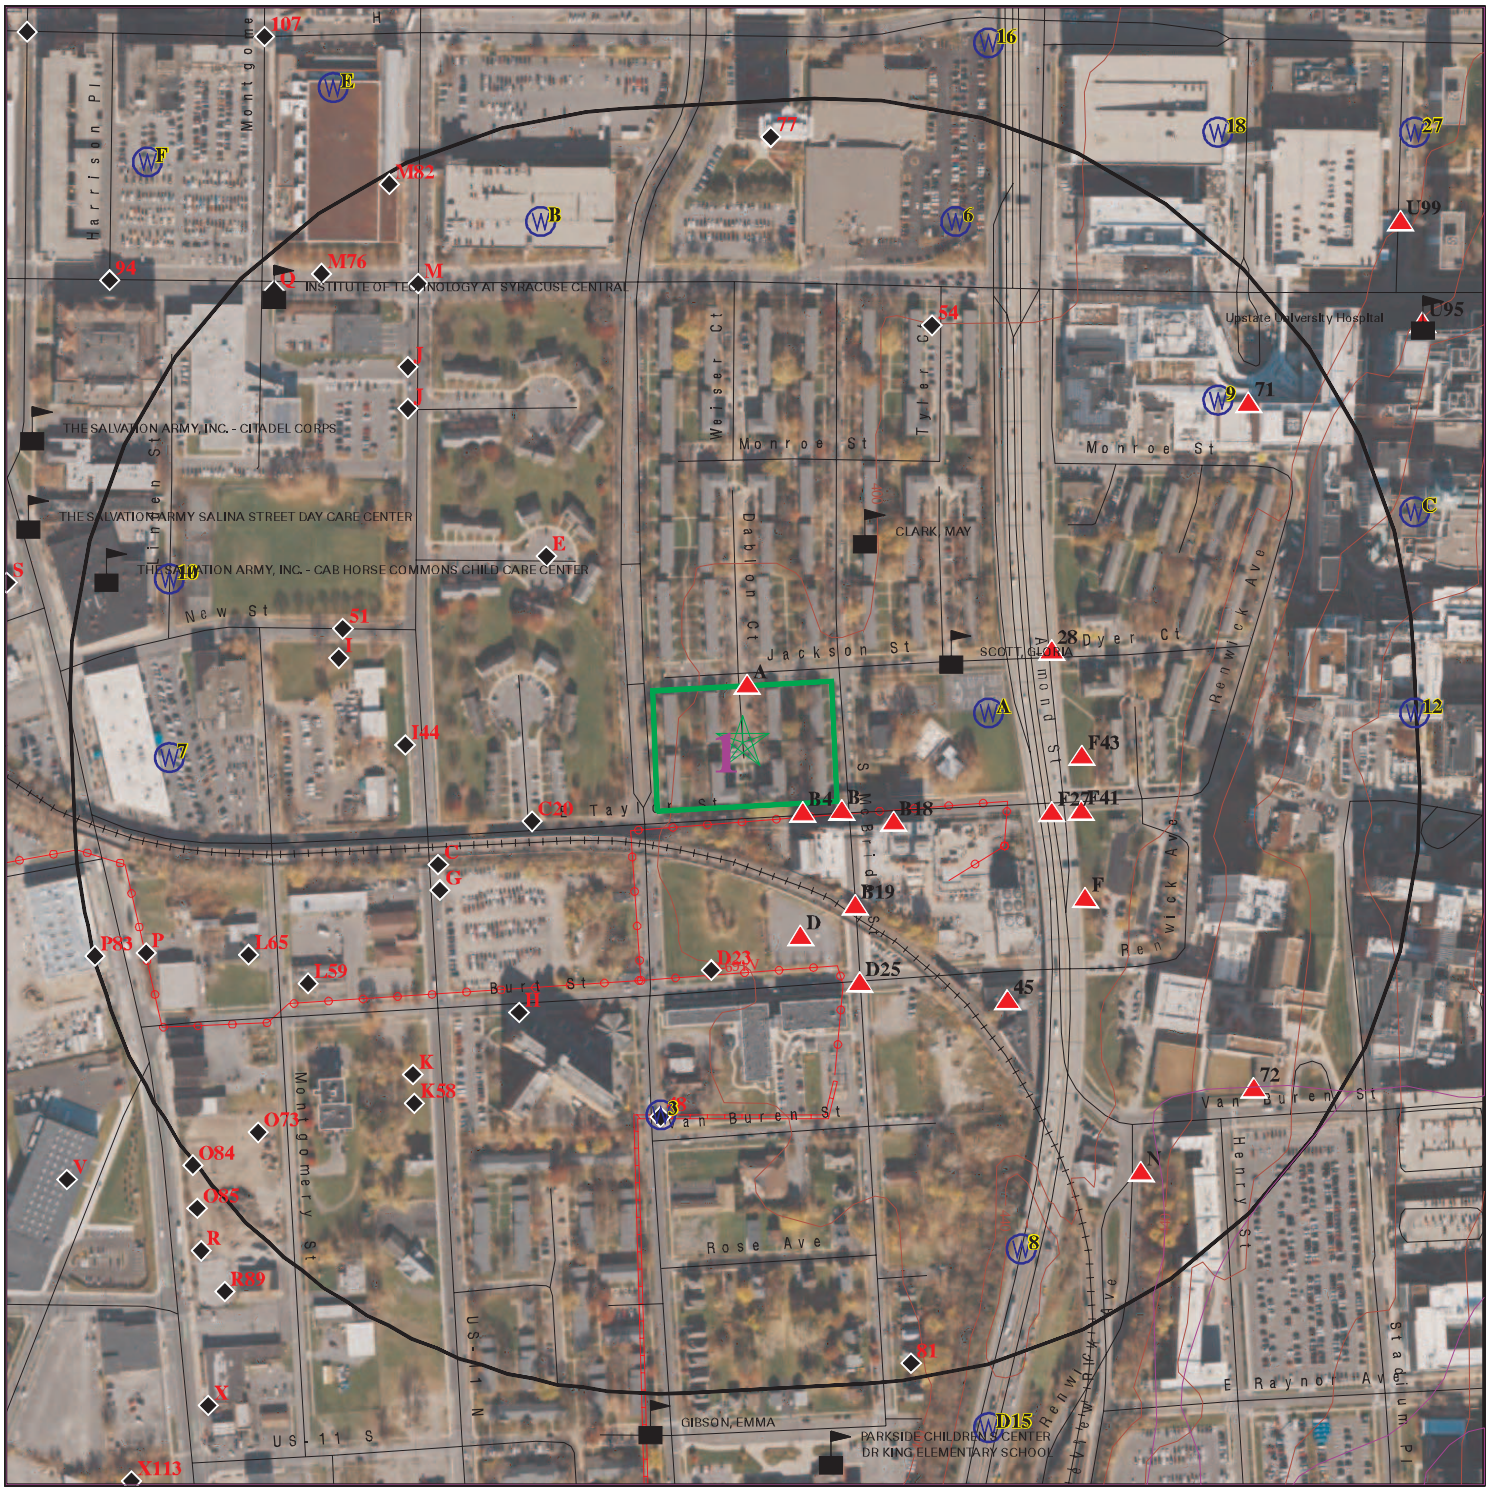

Target Property

Sites at elevations higher than or equal to the target property

Sites at elevations lower than the target property

Manufactured Gas Plants

Sensitive Receptors

National Priority List Sites

Dept. Defense Sites

0 1/16 1/8 1/4 Miles

Indian Reservations BIA

Power transmission lines

Pipelines

Special Flood Hazard Area (1%)

0.2% Annual Chance Flood Hazard

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME:	East Adams Redevelopment - Phase 6 Area	CLIENT:	Langan
ADDRESS:	100 Raddison Court Syracuse NY 13202	CONTACT:	Lexi Haley
LAT/LONG:	43.039903 / 76.144788	INQUIRY #:	8026566.2s
		DATE:	June 23, 2025 11:26 am

Copyright © 2025 EDR, Inc. © 2015 TomTom Rel. 2015.

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
Lists of Federal NPL (Superfund) sites								
NPL	1.000		0	0	0	0	NR	0
Proposed NPL	1.000		0	0	0	0	NR	0
NPL LIENS	1.000		0	0	0	0	NR	0
Lists of Federal Delisted NPL sites								
Delisted NPL	1.000		0	0	0	0	NR	0
Lists of Federal sites subject to CERCLA removals and CERCLA orders								
FEDERAL FACILITY	0.500		0	0	0	NR	NR	0
SEMS	0.500		0	0	0	NR	NR	0
Lists of Federal CERCLA sites with NFRAP								
SEMS-ARCHIVE	0.500		1	0	0	NR	NR	1
Lists of Federal RCRA facilities undergoing Corrective Action								
CORRACTS	1.000		0	0	0	0	NR	0
Lists of Federal RCRA TSD facilities								
RCRA-TSDF	0.500		0	0	0	NR	NR	0
Lists of Federal RCRA generators								
RCRA-LQG	0.250		1	0	NR	NR	NR	1
RCRA-SQG	0.250		2	3	NR	NR	NR	5
RCRA-VSQG	0.250		1	1	NR	NR	NR	2
Federal institutional controls / engineering controls registries								
LUCIS	0.500		0	0	0	NR	NR	0
US ENG CONTROLS	0.500		0	0	0	NR	NR	0
US INST CONTROLS	0.500		0	0	0	NR	NR	0
Federal ERNS list								
ERNS	0.001		0	NR	NR	NR	NR	0
Lists of state- and tribal hazardous waste facilities								
NY SHWS	1.000		0	1	0	2	NR	3
Lists of state and tribal landfills and solid waste disposal facilities								
NY SWF/LF	0.500		0	0	1	NR	NR	1
Lists of state and tribal leaking storage tanks								
INDIAN LUST	0.500		0	0	0	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
NY LTANKS	0.500		4	4	38	NR	NR	46
NY HIST LTANKS	0.500		0	0	0	NR	NR	0
Lists of state and tribal registered storage tanks								
FEMA UST	0.250		0	0	NR	NR	NR	0
NY UST	0.250		5	4	NR	NR	NR	9
NY CBS UST	0.250		0	0	NR	NR	NR	0
NY MOSF UST	0.500		0	0	0	NR	NR	0
NY MOSF	0.500		0	0	0	NR	NR	0
NY CBS	0.250		2	0	NR	NR	NR	2
NY AST	0.250		4	2	NR	NR	NR	6
NY CBS AST	0.250		3	0	NR	NR	NR	3
NY MOSF AST	0.500		0	0	0	NR	NR	0
INDIAN UST	0.250		0	0	NR	NR	NR	0
NY TANKS	0.250		0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
NY RES DECL	0.125		0	NR	NR	NR	NR	0
NY ENG CONTROLS	0.500		1	0	1	NR	NR	2
NY INST CONTROL	0.500		1	0	1	NR	NR	2
Lists of state and tribal voluntary cleanup sites								
NY VCP	0.500		0	0	0	NR	NR	0
INDIAN VCP	0.500		0	0	0	NR	NR	0
Lists of state and tribal brownfield sites								
NY BROWNFIELDS	0.500		2	1	5	NR	NR	8
NY ERP	0.500		1	0	0	NR	NR	1
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.500		0	4	11	NR	NR	15
Local Lists of Landfill / Solid Waste Disposal Sites								
NY SWTIRE	0.500		0	0	0	NR	NR	0
NY SWRCY	0.500		0	0	0	NR	NR	0
INDIAN ODI	0.500		0	0	0	NR	NR	0
ODI	0.500		0	0	0	NR	NR	0
DEBRIS REGION 9	0.500		0	0	0	NR	NR	0
IHS OPEN DUMPS	0.500		0	0	0	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US HIST CDL	0.001		0	NR	NR	NR	NR	0
NY DEL SHWS	1.000		0	0	0	0	NR	0
US CDL	0.001		0	NR	NR	NR	NR	0
Local Lists of Registered Storage Tanks								
NY HIST UST	0.250		0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
NY HIST AST	0.001		0	NR	NR	NR	NR	0
Local Land Records								
NY LIENS	0.001		0	NR	NR	NR	NR	0
LIENS 2	0.001		0	NR	NR	NR	NR	0
Records of Emergency Release Reports								
HMIRS	0.001		0	NR	NR	NR	NR	0
NY Spills	0.125		18	NR	NR	NR	NR	18
NY Hist Spills	0.125		0	NR	NR	NR	NR	0
NY SPILLS 90	0.125		0	NR	NR	NR	NR	0
NY SPILLS 80	0.125		0	NR	NR	NR	NR	0
Other Ascertainable Records								
RCRA NonGen / NLR	0.250		5	6	NR	NR	NR	11
FUDS	1.000		0	0	0	0	NR	0
DOD	1.000		0	0	0	0	NR	0
SCRD DRYCLEANERS	0.500		0	0	0	NR	NR	0
US FIN ASSUR	0.001		0	NR	NR	NR	NR	0
EPA WATCH LIST	0.001		0	NR	NR	NR	NR	0
2020 COR ACTION	0.250		0	0	NR	NR	NR	0
TSCA	0.001		0	NR	NR	NR	NR	0
TRIS	0.001		0	NR	NR	NR	NR	0
SSTS	0.001		0	NR	NR	NR	NR	0
ROD	1.000		0	0	0	0	NR	0
RMP	0.001		0	NR	NR	NR	NR	0
RAATS	0.001		0	NR	NR	NR	NR	0
PRP	0.001		0	NR	NR	NR	NR	0
PADS	0.001		0	NR	NR	NR	NR	0
ICIS	0.001		0	NR	NR	NR	NR	0
FTTS	0.001		0	NR	NR	NR	NR	0
MLTS	0.001		0	NR	NR	NR	NR	0
COAL ASH DOE	0.001		0	NR	NR	NR	NR	0
COAL ASH EPA	0.500		0	0	0	NR	NR	0
PCB TRANSFORMER	0.001		0	NR	NR	NR	NR	0
RADINFO	0.001		0	NR	NR	NR	NR	0
HIST FTTS	0.001		0	NR	NR	NR	NR	0
DOT OPS	0.001		0	NR	NR	NR	NR	0
CONSENT	1.000		0	0	0	0	NR	0
INDIAN RESERV	1.000		0	0	0	0	NR	0
FUSRAP	1.000		0	0	0	0	NR	0
UMTRA	0.500		0	0	0	NR	NR	0
LEAD SMELTERS	0.001		0	NR	NR	NR	NR	0
US AIRS	0.001		0	NR	NR	NR	NR	0
US MINES	0.250		0	0	NR	NR	NR	0
MINES MRDS	0.250		0	0	NR	NR	NR	0
ABANDONED MINES	0.250		0	0	NR	NR	NR	0
FINDS	0.001		1	NR	NR	NR	NR	1
UXO	1.000		0	0	0	0	NR	0
ECHO	0.001		1	NR	NR	NR	NR	1
DOCKET HWC	0.001		0	NR	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
FUELS PROGRAM	0.250		0	0	NR	NR	NR	0
PFAS NPL	0.250		0	0	NR	NR	NR	0
PFAS FEDERAL SITES	0.250		0	0	NR	NR	NR	0
PFAS TSCA	0.250		0	0	NR	NR	NR	0
PFAS TRIS	0.250		0	0	NR	NR	NR	0
PFAS RCRA MANIFEST	0.250		0	0	NR	NR	NR	0
PFAS ATSDR	0.250		0	0	NR	NR	NR	0
PFAS WQP	0.250		0	0	NR	NR	NR	0
PFAS PROJECT	0.250		0	0	NR	NR	NR	0
PFAS NPDES	0.250		0	0	NR	NR	NR	0
PFAS ECHO	0.250		0	1	NR	NR	NR	1
PFAS ECHO FIRE TRAIN	0.250		0	0	NR	NR	NR	0
PFAS PT 139 AIRPORT	0.250		0	0	NR	NR	NR	0
AQUEOUS FOAM NRC	0.250		0	0	NR	NR	NR	0
BIOSOLIDS	0.001		0	NR	NR	NR	NR	0
UST FINDER RELEASE	0.500		2	1	17	NR	NR	20
UST FINDER	0.250		3	3	NR	NR	NR	6
E MANIFEST	0.250		2	2	NR	NR	NR	4
NY PFAS	0.250		1	0	NR	NR	NR	1
NY AIRS	0.001		0	NR	NR	NR	NR	0
NY COAL ASH	0.500		0	0	0	NR	NR	0
NY DRYCLEANERS	0.250		0	0	NR	NR	NR	0
NY E DESIGNATION	0.125		0	NR	NR	NR	NR	0
NY Financial Assurance	0.001		0	NR	NR	NR	NR	0
NY HSWDS	0.500		0	0	0	NR	NR	0
NY LEAD	0.001		0	NR	NR	NR	NR	0
NY MANIFEST	0.250		8	11	NR	NR	NR	19
RI MANIFEST	0.250		0	0	NR	NR	NR	0
PA MANIFEST	0.250		2	2	NR	NR	NR	4
NJ MANIFEST	0.250		1	0	NR	NR	NR	1
NY SPDES	0.001		0	NR	NR	NR	NR	0
NY VAPOR REOPENED	0.500		0	0	0	NR	NR	0
NY UIC	0.001		0	NR	NR	NR	NR	0
NY COOLING TOWERS	0.001		0	NR	NR	NR	NR	0
NY NYC LAND USE	0.001		0	NR	NR	NR	NR	0
NY NYC OER	1.000		0	0	0	0	NR	0
NY ILI	0.500		0	0	0	NR	NR	0
NY MGP	1.000		0	0	0	1	NR	1
EDR HIGH RISK HISTORICAL RECORDS								
EDR Exclusive Records								
EDR MGP	1.000		0	0	0	1	NR	1
EDR Hist Auto	0.125		1	NR	NR	NR	NR	1
EDR Hist Cleaner	0.125		0	NR	NR	NR	NR	0
EDR RECOVERED GOVERNMENT ARCHIVES								
Exclusive Recovered Govt. Archives								
NY RGA HWS	0.001		0	NR	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
NY RGA LF	0.001		0	NR	NR	NR	NR	0
- Totals --		0	73	46	74	4	0	197

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

A1 **SYRACUSE HOUSING AUTH - PIONEER HOMES** **FINDS** **1010690583**
116-118 RADISSON COURT **ECHO** **N/A**
< 1/8 **SYRACUSE, NY 13202**
1 ft.

Site 1 of 3 in cluster A

Relative: FINDS:
Lower Registry ID: 110033157232

Actual:
401 ft. Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1010690583
Registry ID: 110033157232

DFR URL:
Name: SYRACUSE HOUSING AUTH - PIONEER HOMES
Address: 116-118 RADISSON COURT
City,State,Zip: SYRACUSE, NY 13202

A2 **SYRACUSE HOUSING AUTH - PIONEER HOMES** **RCRA-SQG** **1010566800**
116-118 RADISSON COURT **NY MANIFEST** **NYR000154476**
< 1/8 **SYRACUSE, NY 13202**
1 ft.

Site 2 of 3 in cluster A

Relative: RCRA Listings:
Lower

Actual:
401 ft.

Date Form Received by Agency:	20080205
Handler Name:	Syracuse Housing Auth - Pioneer Homes
Handler Address:	Radisson Court
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYR000154476
Contact Name:	WILLIAM W GEHRKE
Contact Address:	BURT ST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-470-4315
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Other
Federal Waste Generator Description:	Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	RADISSON COURT
Mailing City,State,Zip:	SYRACUSE, NY 13202

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566800**

Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
202 GPRA Corrective Action Baseline:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No
Addressed Significant Non-Complier Universe:		No
Significant Non-Complier With a Compliance Schedule Universe:		No
Financial Assurance Required:		Not reported
Handler Date of Last Change:		20150414
Recognized Trader-Importer:		No
Recognized Trader-Exporter:		No
Importer of Spent Lead Acid Batteries:		No
Exporter of Spent Lead Acid Batteries:		No
Recycler Activity Without Storage:		No
Manifest Broker:		No
Sub-Part P Indicator:		No

Hazardous Waste Summary:

Waste Code:	D002
Waste Description:	Corrosive Waste

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name:	SYRACUSE HOUSING AUTH
Legal Status:	Other
Date Became Current:	19400101
Date Ended Current:	Not reported

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566800**

Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE HOUSING AUTH
Legal Status: Other
Date Became Current: 19400101
Date Ended Current: Not reported
Owner/Operator Address: 516 BURT ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20080205
Handler Name: SYRACUSE HOUSING AUTH - PIONEER HOMES
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080206
Handler Name: SYRACUSE HOUSING AUTH - PIONEER HOMES
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 92511
NAICS Description: Administration Of Housing Programs

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566800**

NY MANIFEST:

EPA ID:	NYR000154476
Country:	USA
Name:	Syracuse Housing Auth - Pioneer Homes
Address:	116-118 RADISSON COURT
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	116-118 RADISSON COURT
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Syracuse Housing Auth - Pioneer Homes
Mailing Contact:	William Gekrke
Mailing Address 1:	516 BURT ST
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154704315

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	NYD980761191
Generator Ship Date:	03/12/2008
Trans1 Recv Date:	03/12/2008
Trans2 Recv Date:	03/21/2008
TSD Site Recv Date:	03/25/2008
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000154476
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	000885784FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Corrosive Waste
Waste Code b:	Not reported

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566800**

Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	30
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

A3 **PARKING LOT- 111 RADISON COURT** **NY Spills** **S126996788**
111 RADISON CT **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.001 mi.
3 ft. **Site 3 of 3 in cluster A**

Relative:
Higher

Actual:
402 ft.

SPILLS:

Name:	PARKING LOT- 111 RADISON COURT
Address:	111 RADISON CT
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	2005041 / 2022-05-13
Facility ID:	2005041
Facility Type:	ER
DER Facility ID:	559030
Site ID:	610813
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	B1
SWIS:	3415
Spill Date:	2020-09-01
Investigator:	CFNORRIS
Referred To:	Not reported
Reported to Dept:	2020-09-01
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Passenger Vehicle
Spill Notifier:	Fire Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	2020-09-01
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2020-09-01
Spill Record Last Update:	2022-06-06
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	ASHLEY

PARKING LOT- 111 RADISON COURT (Continued) **S126996788**

Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	RP HIT DEBRIS ON HIGHWAY. HER GAS TANK AND TIRE WERE PUNCTURED. TANK PLUG FAILED, AND GAS LEAKED ONTO PARKING LOT OUTSIDE RP'S SISTER'S APARTMENT ON RADISSON COURT. SYRACUSE FD NOTIFIED AFTER PROGRESSIVE RECOMMENDATION. FD PUT DOWN SPEEDY-DRI AND NOTIFIED HOTLINE. I TOOK 15 MINUTES TO REACH SPILL SITE. FD WAS ALREADY OFF-SITE. PROGRESSIVE HIRED TOW COMPANY, BUT THEY WERE NOT PREPARED TO REMOVE SPEEDY-DRI OR CONTINUE LOCATION DECOMMTAMINATION. I HIRED NRC TO CLEAR PARKING LOT OF GASOLINE SPILL. A MAN CAME OVER TO TALK TO FEMALE DRIVER. I DO NOT KNOW IF THAT WAS THE REGISTERED VEHICLE OWNER. VEHICLE PLATE IS JRP-7723. FEMALE DRIVER NAME IS UNKNOWN. 11/2021 I CALLED SYRACUSE FIRE. THEY WERE UNABLE TO SUPPLY REPORTS WITHOUT A FEE. 06/06/2022 I DECIDED TO CONTACT THE SHERIFF RECORDS, IN CASE THEY HAD A CONTACT WITH CITY FIRE. THE SHERIFF RECORDS CONTACT STATED THAT THE SHERIFF HAS ACCESS TO CITY FIRE REPORTS, BUT, THIS SPILL HAS NO REPORT. IT WAS LISTED AS A HAZARD CALL (E10), AND WITHDRAWN. THE DR NUMBER IS DR 20-41725.
Remarks:	c/u pending

All Materials:

Site ID:	610813
Operable Unit ID:	1357959
Operable Unit:	01
Material ID:	2369387
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	PARKING LOT- 111 RADISON COURT
Address:	111 RADISON CT
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	2005041 / 2022-05-13
Facility ID:	2005041
Facility Type:	ER
DER Facility ID:	559030
Site ID:	610813
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	B1
SWIS:	3415
Spill Date:	2020-09-01
Investigator:	CFNORRIS
Referred To:	Not reported
Reported to Dept:	2020-09-01
CID:	Not reported

PARKING LOT- 111 RADISON COURT (Continued) **S126996788**

Water Affected:	Not reported
Spill Source:	Passenger Vehicle
Spill Notifier:	Fire Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	2020-09-01
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2020-09-01
Spill Record Last Update:	2022-06-06
Spiller Name:	tyrone j english jr
Spiller Company:	registered car owner
Spiller Address:	614 oakwood ave
Spiller Company:	999
Contact Name:	ASHLEY
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	RP HIT DEBRIS ON HIGHWAY. HER GAS TANK AND TIRE WERE PUNCTURED. TANK PLUG FAILED, AND GAS LEAKED ONTO PARKING LOT OUTSIDE RP'S SISTER'S APARTMENT ON RADISSON COURT. SYRACUSE FD NOTIFIED AFTER PROGRESSIVE RECOMMENDATION. FD PUT DOWN SPEEDY-DRI AND NOTIFIED HOTLINE. I TOOK 15 MINUTES TO REACH SPILL SITE. FD WAS ALREADY OFF-SITE. PROGRESSIVE HIRED TOW COMPANY, BUT THEY WERE NOT PREPARED TO REMOVE SPEEDY-DRI OR CONTINUE LOCATION DECOMMTAMINATION. I HIRED NRC TO CLEAR PARKING LOT OF GASOLINE SPILL. A MAN CAME OVER TO TALK TO FEMALE DRIVER. I DO NOT KNOW IF THAT WAS THE REGISTERED VEHICLE OWNER. VEHICLE PLATE IS JRP-7723. FEMALE DRIVER NAME IS UNKNOWN. 11/2021 I CALLED SYRACUSE FIRE. THEY WERE UNABLE TO SUPPLY REPORTS WITHOUT A FEE. 06/06/2022 I DECIDED TO CONTACT THE SHERIFF RECORDS, IN CASE THEY HAD A CONTACT WITH CITY FIRE. THE SHERIFF RECORDS CONTACT STATED THAT THE SHERIFF HAS ACCESS TO CITY FIRE REPORTS, BUT, THIS SPILL HAS NO REPORT. IT WAS LISTED AS A HAZARD CALL (E10), AND WITHDRAWN. THE DR NUMBER IS DR 20-41725.
Remarks:	c/u pending

All Materials:

Site ID:	610813
Operable Unit ID:	1357959
Operable Unit:	01
Material ID:	2369387
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

B4 **STEAM PLANT** **NY LTANKS** **S104278476**
SE **MCBRIDE ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.004 mi.
19 ft. **Site 1 of 16 in cluster B**

Relative:
Higher

Actual:
407 ft.

LTANKS:

Name:	STEAM PLANT
Address:	MCBRIDE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9908800 / 1999-11-23
Facility ID:	9908800
Site ID:	259520
Spill Date:	1999-10-20
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1999-10-20
CID:	257
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1999-10-20
Spill Record Last Update:	1999-11-23
Spiller Name:	JIM MCCUMBER
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	285 AINSLEY DR
Spiller County:	001
Spiller Contact:	PAT STOCK
Spiller Phone:	(315) 443-4132
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	212253
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	old contamination from a old tank that was closed 10yrs ago

All Materials:

Site ID:	259520
Operable Unit ID:	1087484
Operable Unit:	01
Material ID:	297899
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

B5
SE
< 1/8
0.004 mi.
22 ft.

INTERSECTION OF
EAST TAYLOR/SOUTH MCBRIDE
SYRACUSE, NY

Site 2 of 16 in cluster B

NY Spills **S107787451**
N/A

Relative:
Higher

Actual:
406 ft.

SPILLS:

Name:	INTERSECTION OF
Address:	EAST TAYLOR/SOUTH MCBRIDE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0600689 / 2006-04-19
Facility ID:	0600689
Facility Type:	ER
DER Facility ID:	312985
Site ID:	362754
DEC Region:	7
Spill Cause:	Other
Spill Class:	D3
SWIS:	3415
Spill Date:	2006-04-18
Investigator:	KCKemp
Referred To:	Not reported
Reported to Dept:	2006-04-18
CID:	444
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	2006-04-19
Cleanup Meets Std:	True
Last Inspection:	2006-04-18
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2006-04-18
Spill Record Last Update:	2006-04-19
Spiller Name:	GLENN WILLIAMS
Spiller Company:	NATIONAL GRID
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	001
Contact Name:	GLENN WILLIAMS
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	cleaned up by optech. no stains noted.
Remarks:	THEY WERE REELING HOSE AND OI LEAKED OUT AND OPTECH IS ENROUTE TO CLEAN UP

All Materials:

Site ID:	362754
Operable Unit ID:	1120827
Operable Unit:	01
Material ID:	2110318
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

B6 **STEAM HEAT SYR. UNIVERS.** **NY Spills** **S102164496**
SE **TALOR & MCBRIDE ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.007 mi.
37 ft. **Site 3 of 16 in cluster B**

Relative:
Higher

Actual:
406 ft.

SPILLS:

Name:	STEAM HEAT SYR. UNIVERS.
Address:	TALOR & MCBRIDE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8801654 / 1995-02-09
Facility ID:	8801654
Facility Type:	ER
DER Facility ID:	211093
Site ID:	257809
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	B3
SWIS:	3415
Spill Date:	1988-05-23
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	1988-05-23
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Affected Persons
Cleanup Ceased:	1995-02-09
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1988-06-07
Spill Record Last Update:	1995-02-09
Spiller Name:	Not reported
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	Not reported
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was HW 01/19/89: DEC MONITORING THE CLEANUP EFFORTS. 04/12/91: NEW FUEL STORAGE TANKS WERE INSTALLED BY SU DURING SUMMER OF 90. LARGE QUANTITY OF CONTAMINATED SOIL REMOVED. STAN TALLET OF STEAM STATION CURRENTLY MONITORING. 06/19/91: MET STAN TALLET AT SITE CHECKED WELL ADJACENT TO RECOVERY SYSTEM FORPRODUCT. LAYER OF FUEL STILL PRESENT IN WELL. SU TO EXCAVATE AROUND WELL SOMTIME IN JULY. 02/07/92: MEETING AT STEAM STATION SU WILL DO SOIL BORINGS BEFORE EXCAVATING SOIL. WORK SCHEDULED FOR 02/06/92. CRAIG BUTLER OF ES HANDLING PROJECT. 06/27/92: SOIL EXCAVATED AREA OF APPROX 15’ BY 20’ REMOVED GARY DYER HAULED CONTAMINATED SOIL. ES ON SITE TO OVER SEE EXCAVATION, WILL SEND CLOSURE REPORT.
Remarks:	BARRY KOUGOT 422-0121. DRILLING AND HIT OIL. 6 TO 18 OF FUEL OILON

STEAM HEAT SYR. UNIVERS. (Continued) **S102164496**

GROUND WATER. FOUND ABANDONED 15K TANK ;FULL OF WATER AND FUEL OIL.

All Materials:

Site ID:	257809
Operable Unit ID:	917147
Operable Unit:	01
Material ID:	460784
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

B7 **E. TAYLOR AND MCBRIDE ST.** **NY Spills** **S102165193**
SE **EAST TAYLOR AND MCBRIDE** **N/A**
< 1/8 **SYRACUSE, NY**
0.007 mi.
38 ft. **Site 4 of 16 in cluster B**

Relative:
Higher

Actual:
406 ft.

SPILLS:

Name:	E. TAYLOR AND MCBRIDE ST.
Address:	EAST TAYLOR AND MCBRIDE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9204042 / 1992-07-08
Facility ID:	9204042
Facility Type:	ER
DER Facility ID:	196313
Site ID:	238382
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	E6
SWIS:	3415
Spill Date:	1992-07-08
Investigator:	RJBRAZEL
Referred To:	Not reported
Reported to Dept:	1992-07-08
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Citizen
Cleanup Ceased:	1992-07-08
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1992-07-20
Spill Record Last Update:	1993-04-06
Spiller Name:	Not reported
Spiller Company:	NO NAME CONSTRUCTION CO
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported

E. TAYLOR AND MCBRIDE ST. (Continued) **S102165193**

Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was RB 09/28/95: This is additional information about material spilled from the translation of the old spill file: HEAVY YELLOW SMOKE.
Remarks:	CALLER AND SEVERAL OTHER BUSINESS PEOPLE IN THE VICINITY ARE CONCERNEDBECAUSE SMALL CHILDREN ARE PLAYING IN THE AREA

All Materials:

Site ID:	238382
Operable Unit ID:	971435
Operable Unit:	01
Material ID:	411798
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Air
Oxygenate:	Not reported

B8 **TAYLOR & MCBRIDE ST.- PCB** **NY Spills** **S103567303**
SE **TAYLOR AND MCBRIDE ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.007 mi.
38 ft. **Site 5 of 16 in cluster B**

Relative: **Higher**

Actual: **406 ft.**

SPILLS:

Name:	TAYLOR & MCBRIDE ST.- PCB
Address:	TAYLOR AND MCBRIDE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9107234 / 1991-11-12
Facility ID:	9107234
Facility Type:	ER
DER Facility ID:	230968
Site ID:	284835
DEC Region:	7
Spill Cause:	Other
Spill Class:	Not reported
SWIS:	3415
Spill Date:	1991-10-05
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1991-10-05
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Affected Persons
Cleanup Ceased:	1991-10-07
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0

TAYLOR & MCBRIDE ST.- PCB (Continued) **S103567303**

Date Entered In Computer:	1991-10-07
Spill Record Last Update:	1991-11-12
Spiller Name:	Not reported
Spiller Company:	NIAGRA MOHAWK POWER CO.
Spiller Address:	300 ERIE BLVD.
Spiller Company:	001
Contact Name:	Not reported
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 10/07/91: NIMO PERSONEL PERFORMING CLEANUP. TO SEND CLOSURE REPORT W/SAMPLING RESULT FROM SPILL SITE. 11/12/91: REC'D DOCUMENTATION REPORT REGARDING CLEANUP FROM NIAGRA-MOHAWK.
Remarks:	BLDG. CONSTRUCTION PROJECT COLLASPED BRINGING DOWN THREE UTILITY POLES. ONE TRANSFORMER LEAKED WHEN IT HIT THE GROUND.

All Materials:

Site ID:	284835
Operable Unit ID:	957577
Operable Unit:	01
Material ID:	419452
Material Code:	0017A
Material Name:	PCB oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20.00
Units:	G
Recovered:	19.00
Resource Affected:	Soil
Oxygenate:	Not reported

B9 **SYRACUSE UNIV STEAM STATION** **NY Spills** **S117974012**
SE **500 EAST TAYLOR ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.012 mi.
61 ft. **Site 6 of 16 in cluster B**

Relative: **Higher**
Actual: **406 ft.**

SPILLS:

Name:	SYRACUSE UNIV STEAM STATION
Address:	500 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1502394 / 2016-04-08
Facility ID:	1502394
Facility Type:	ER
DER Facility ID:	463342
Site ID:	508657
DEC Region:	7
Spill Cause:	Human Error
Spill Class:	B3
SWIS:	3415
Spill Date:	2015-06-03
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2015-06-03
CID:	Not reported
Water Affected:	Not reported

SYRACUSE UNIV STEAM STATION (Continued) **S117974012**

Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	2016-04-08
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2015-06-03
Spill Record Last Update:	2016-04-08
Spiller Name:	BECKY PONZA
Spiller Company:	SYRACUSE UNIV STEAM STATION
Spiller Address:	500 EAST TAYLOR ST
Spiller Company:	999
Contact Name:	BECKY PONZA
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	NO ACTIVE CBS REGISTRATION AT THIS FACILITY AND MATERIAL SPILLED IS NOT STORED IN BULK AT THIS FACILITY. THEREFORE HAZ SPILL MUNI REPORTING NOT NECESSARY. SOIL AND ASPHALT PARKING LOT CLEANED BY SU PERSONNEL. SMALL AMOUNT OF MATERIAL SPILLED TO GRAVEL ON LOT NEXT DOOR THAT SU EXCAVATED AND DISPOSED OF ALSO. 7/22/2015 - Disposal documentation requested. KCKemp 4/8/2016 - No disposal documentation received. Spill closed as not meeting standards due to lack of disposal documentation. KCKemp
Remarks:	mixture was being pumped out of drum, loss to soil. C/u pending

All Materials:

Site ID:	508657
Operable Unit ID:	1257965
Operable Unit:	01
Material ID:	2261031
Material Code:	0039A
Material Name:	sulfuric acid
Case No.:	07664939
Material FA:	Hazardous Material
Quantity:	15.00
Units:	G
Recovered:	15.00
Resource Affected:	Soil, Impervious Surface
Oxygenate:	Not reported

Site ID:	508657
Operable Unit ID:	1257965
Operable Unit:	01
Material ID:	2261032
Material Code:	0110A
Material Name:	phosphoric acid
Case No.:	07664382
Material FA:	Hazardous Material
Quantity:	15.00
Units:	G
Recovered:	15.00
Resource Affected:	Soil, Impervious Surface
Oxygenate:	Not reported

B10
SE
< 1/8
0.012 mi.
61 ft.

SYRACUSE UNIVERSITY STEAM STATION
500 EAST TAYLOR ST
SYRACUSE, NY

Site 7 of 16 in cluster B

UST FINDER | **1028588722** | **N/A**

Relative:
Higher

Actual:
406 ft.

UST FINDER:

Object ID:	318218
Facility ID:	NY44931
Name:	SYRACUSE UNIVERSITY STEAM STATION
Address:	500 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY
Address Match Type:	Not reported
Open USTs:	4
Closed USTs:	3
TOS USTs:	0
Population 1500ft:	3032
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Open UST(s)
Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.143772
Y Coord:	43.039411
Latitude:	43.039411
Longitude:	-76.143772

UST FINDER:

Object ID:	1277884
Facility ID:	NY44931
Tank ID:	NY70351
Tank Status:	Closed
Installation Date:	1963/01/01 16:00:01+00
Removal Date:	Not reported
Tank Capacity:	30000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1277885
Facility ID:	NY44931
Tank ID:	NY70352
Tank Status:	Open
Installation Date:	1989/08/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	30000
Substances:	Not reported
Tank Wall Type:	Not reported

SYRACUSE UNIVERSITY STEAM STATION (Continued) **1028588722**

Object ID:	1277886
Facility ID:	NY44931
Tank ID:	NY70956
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	Not reported
Tank Capacity:	15000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1277887
Facility ID:	NY44931
Tank ID:	NY71906
Tank Status:	Closed
Installation Date:	1963/01/01 16:00:01+00
Removal Date:	Not reported
Tank Capacity:	30000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1277888
Facility ID:	NY44931
Tank ID:	NY71907
Tank Status:	Open
Installation Date:	1989/08/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	30000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1277889
Facility ID:	NY44931
Tank ID:	NY73477
Tank Status:	Open
Installation Date:	1989/08/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	30000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1277890
Facility ID:	NY44931
Tank ID:	NY75588
Tank Status:	Open
Installation Date:	1989/08/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	30000
Substances:	Not reported
Tank Wall Type:	Not reported

B11 **STEAM STATION** **NY Spills** **S123660417**
SE **500 EAST TAYLOR ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.012 mi.
61 ft. **Site 8 of 16 in cluster B**

Relative:
Higher

Actual:
406 ft.

SPILLS:

Name:	STEAM STATION
Address:	500 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1810736 / 2019-03-26
Facility ID:	1810736
Facility Type:	ER
DER Facility ID:	424153
Site ID:	581643
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2019-01-23
Investigator:	DJLASALL
Referred To:	Not reported
Reported to Dept:	2019-01-23
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2019-01-23
Spill Record Last Update:	2019-03-26
Spiller Name:	Not reported
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	CHAD AMES
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	cleanup completed by RP.
Remarks:	some sprayed outside storage area, most contained. Spill onto crushed stone and snow. clean up in progress.

All Materials:

Site ID:	581643
Operable Unit ID:	1329333
Operable Unit:	01
Material ID:	2338393
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	2.00
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

B12 **SYRACUSE UNIVERSITY - STEAM STATION** **RCRA NonGen / NLR** **1000145092**
SE **500 E TAYLOR ST** **E MANIFEST** **NYD982271918**
< 1/8 **SYRACUSE, NY 13244** **NJ MANIFEST**
0.012 mi.
61 ft. **Site 9 of 16 in cluster B**

Relative:
Higher

Actual:
406 ft.

RCRA Listings:

Date Form Received by Agency:	20190503
Handler Name:	Syracuse University - Steam Station
Handler Address:	E Taylor St
Handler City,State,Zip:	SYRACUSE, NY 13244
EPA ID:	NYD982271918
Contact Name:	Not reported
Contact Address:	Not reported
Contact City,State,Zip:	Not reported
Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	Not reported
Mailing City,State,Zip:	Not reported
Owner Name: Not reported	
Owner Type:	Not reported
Operator Name: Not reported	
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20190503
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	D002
Waste Description:	Corrosive Waste
Waste Code:	F001
Waste Description:	The Following Spent Halogenated Solvents Used In Degreasing: Tetrachloroethylene, Trichlorethylene, Methylene Chloride, 1,1,1-Trichloroethane, Carbon Tetrachloride And Chlorinated Fluorocarbons; All Spent Solvent Mixtures/Blends Used In Degreasing Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Halogenated Solvents Or Those Solvents Listed In F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code:	F002
Waste Description:	The Following Spent Halogenated Solvents: Tetrachloroethylene, Methylene Chloride, Trichloroethylene, 1,1,1-Trichloroethane, Chlorobenzene, 1,1,2-Trichloro-1,2,2-Trifluoroethane, Ortho-Dichlorobenzene, Trichlorofluoromethane, And 1,1,2, Trichloroethane; All Spent Solvent Mixtures/Blends Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Halogenated Solvents Or Those Solvents Listed In F001, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	SYRACUSE UNIV BD OF TRUSTEES
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	TOLLEY ADMINISTRATION BLDG
Owner/Operator City,State,Zip:	SYRACUSE, NY 13244
Owner/Operator Telephone:	315-443-4132
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE UNIV BD OF TRUSTEES
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: TOLLEY ADMINISTRATION BLDG
Owner/Operator City,State,Zip: SYRACUSE, NY 13244
Owner/Operator Telephone: 315-443-4132
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SYRACUSE UNIV BD OF TRUSTEES
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: TOLLEY ADMINISTRATION BLDG
Owner/Operator City,State,Zip: SYRACUSE, NY 13244
Owner/Operator Telephone: 315-443-4132
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SYRACUSE UNIVERSITY
Legal Status: Private
Date Became Current: 19270101
Date Ended Current: Not reported
Owner/Operator Address: 900 S CROUSE AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13244
Owner/Operator Telephone: 315-443-4132
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: 315-443-3081
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE UNIVERSITY
Legal Status: Private
Date Became Current: 19270101
Date Ended Current: Not reported
Owner/Operator Address: 900 S CROUSE AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13244
Owner/Operator Telephone: 315-443-4132
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: 315-443-3081
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20060101
Handler Name: SYRACUSE UNIV - STEAM STATION
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: SYRACUSE UNIV - STEAM STATION
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20190503
Handler Name: SYRACUSE UNIVERSITY - STEAM STATION
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 19870807
Handler Name: SYRACUSE UNIV - STEAM STATION
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920228
Handler Name: SYRACUSE UNIVERSITY STEAM STATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20180502
Handler Name: SYRACUSE UNIVERSITY - STEAM STATION
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

List of NAICS Codes and Descriptions:
NAICS Code: 61131
NAICS Description: Colleges, Universities, And Professional Schools

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

E MANIFEST:
Manifest Tracking Number: 001563043VES
Last Updated Date: 20190515
Shipped Date: 20190424
Received Date: 20190501
Manifest Status: Signed
Submission Type: DataImage5Copy
Origin Type: Service
Generator EPA ID: NYD982271918
Generator Name: Syracuse University-Steam Sta
Generator Location Street Number: Not reported
Generator Location Street 1: 500 EAST TAYLOR ST
Generator Location Street 2: STEAM STATION
Generator Location City: SYRACUSE
Generator Location State: NY
Generator Location Zip: 13244-0000
Generator Mail Street Number: Not reported
Generator Mail Street 1: C/O EHSS
Generator Mail Street 2: 100 College Place
Generator Mail City: SYRACUSE
Generator Mail Zip: 13244-0000
Generator Mail State: NY
Generator Contact Company Name: Not reported
Designated Facility EPA ID: NJD980536593
Designated Facility Name: Not reported
Designated Facility Mail Street Number: 1

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	1 EDEN LANE
Designated Facility Mail City:	FLANDERS
Designated Facility Mail Zip:	07836
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	1
Designated Facility Location Street 1:	1 EDEN LANE
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	FLANDERS
Designated Facility Location Zip:	07836
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	Veolia Es Technical Solutions Llc
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	001563044VES
Last Updated Date:	20190605
Shipped Date:	20190424
Received Date:	20190501
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 EAST TAYLOR ST
Generator Location Street 2:	STEAM STATION
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13244-0000
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	C/O EHSS
Generator Mail Street 2:	100 College Place
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13244-0000
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	OHD093945293
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	PO BOX 453
Designated Facility Mail Street 2:	4301 INFIRMARY RD
Designated Facility Mail City:	WEST CARROLLTON
Designated Facility Mail Zip:	45449
Designated Facility Mail State:	OH
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	4301 INFIRMARY RD
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	WEST CARROLLTON
Designated Facility Location Zip:	45449-1278
Designated Facility Location State:	OH
Designated Facility Contact Company Name:	Veolia Es Technical Solutions Llc
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	001563623VES
Last Updated Date:	20220512

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Shipped Date:	20220428
Received Date:	20220504
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 EAST TAYLOR ST
Generator Location Street 2:	STEAM STATION
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13244
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	C/O EHSS
Generator Mail Street 2:	100 College Place
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13244
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD980536593
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	1
Designated Facility Mail Street 1:	1 EDEN LANE
Designated Facility Mail Street 2:	L.L.C.
Designated Facility Mail City:	FLANDERS
Designated Facility Mail Zip:	07836
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	1
Designated Facility Location Street 1:	L.L.C.
Designated Facility Location Street 2:	1 EDEN LANE
Designated Facility Location City:	FLANDERS
Designated Facility Location Zip:	07836
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	Veolia Es Technical Solutions
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	001563639VES
Last Updated Date:	20220708
Shipped Date:	20220601
Received Date:	20220615
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 EAST TAYLOR ST
Generator Location Street 2:	STEAM STATION
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13244
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	C/O EHSS
Generator Mail Street 2:	100 College Place
Generator Mail City:	SYRACUSE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Generator Mail Zip:	13244
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD980536593
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	1
Designated Facility Mail Street 1:	1 EDEN LANE
Designated Facility Mail Street 2:	L.L.C.
Designated Facility Mail City:	FLANDERS
Designated Facility Mail Zip:	07836
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	1
Designated Facility Location Street 1:	L.L.C.
Designated Facility Location Street 2:	1 EDEN LANE
Designated Facility Location City:	FLANDERS
Designated Facility Location Zip:	07836
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	Veolia Es Technical Solutions
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	001563659VES
Last Updated Date:	20220926
Shipped Date:	20220824
Received Date:	20220831
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 EAST TAYLOR ST
Generator Location Street 2:	STEAM STATION
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13244
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	C/O EHSS
Generator Mail Street 2:	100 College Place
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13244
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD980536593
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	1
Designated Facility Mail Street 1:	1 EDEN LANE
Designated Facility Mail Street 2:	L.L.C.
Designated Facility Mail City:	FLANDERS
Designated Facility Mail Zip:	07836
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	1
Designated Facility Location Street 1:	L.L.C.
Designated Facility Location Street 2:	1 EDEN LANE
Designated Facility Location City:	FLANDERS
Designated Facility Location Zip:	07836
Designated Facility Location State:	NJ

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Designated Facility Contact Company Name:	Veolia Es Technical Solutions
Manifest Residue Indicator:	N
Rejection Indicator:	N
Manifest Tracking Number:	001556606VES
Last Updated Date:	20191226
Shipped Date:	20191206
Received Date:	20191218
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 EAST TAYLOR ST
Generator Location Street 2:	STEAM STATION
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13244
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	C/O EHSS
Generator Mail Street 2:	100 College Place
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13244
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD002454544
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	125 FACTORY LN
Designated Facility Mail City:	MIDDLESEX
Designated Facility Mail Zip:	08846
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	125 FACTORY LN
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	MIDDLESEX
Designated Facility Location Zip:	08846
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	Veolia Es Technical Solutions Llc
Manifest Residue Indicator:	N
Rejection Indicator:	N
Manifest Tracking Number:	001560223VES
Last Updated Date:	20230417
Shipped Date:	20230315
Received Date:	20230324
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 EAST TAYLOR ST
Generator Location Street 2:	STEAM STATION
Generator Location City:	SYRACUSE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Generator Location State:	NY
Generator Location Zip:	13244
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	C/O EHSS
Generator Mail Street 2:	100 College Place
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13244
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD980536593
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	1
Designated Facility Mail Street 1:	1 EDEN LANE
Designated Facility Mail Street 2:	L.L.C.
Designated Facility Mail City:	FLANDERS
Designated Facility Mail Zip:	07836
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	1
Designated Facility Location Street 1:	L.L.C.
Designated Facility Location Street 2:	1 EDEN LANE
Designated Facility Location City:	FLANDERS
Designated Facility Location Zip:	07836
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	Veolia Es Technical Solutions
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	001558051VES
Last Updated Date:	20200304
Shipped Date:	20200220
Received Date:	20200228
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 EAST TAYLOR ST
Generator Location Street 2:	STEAM STATION
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13244
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	C/O EHSS
Generator Mail Street 2:	100 College Place
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13244
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	OHD093945293
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	4301 INFIRMARY RD PO BOX 453
Designated Facility Mail City:	WEST CARROLLTON
Designated Facility Mail Zip:	45342
Designated Facility Mail State:	OH

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	4301 INFIRMARY RD
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	WEST CARROLLTON
Designated Facility Location Zip:	45449
Designated Facility Location State:	OH
Designated Facility Contact Company Name:	Veolia Es Technical Solutions Llc
Manifest Residue Indicator:	N
Rejection Indicator:	N
Manifest Tracking Number:	001556943VES
Last Updated Date:	20201211
Shipped Date:	20201120
Received Date:	20201201
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD982271918
Generator Name:	Syracuse University-Steam Sta
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 EAST TAYLOR ST
Generator Location Street 2:	STEAM STATION
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13244-0000
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	C/O EHSS
Generator Mail Street 2:	100 College Place
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13244-0000
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD980536593
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	1
Designated Facility Mail Street 1:	1 EDEN LANE
Designated Facility Mail Street 2:	L.L.C.
Designated Facility Mail City:	FLANDERS
Designated Facility Mail Zip:	07836
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	1
Designated Facility Location Street 1:	L.L.C.
Designated Facility Location Street 2:	1 EDEN LANE
Designated Facility Location City:	FLANDERS
Designated Facility Location Zip:	07836
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	Veolia Es Technical Solutions
Manifest Residue Indicator:	N
Rejection Indicator:	N

Transporter:

Manifest Tracking Number:	001556943VES
Transporter Line Number:	1
Transporter EPA ID:	NJD080631369
Transporter Name:	Veolia Es Technical Solutions
Manifest Tracking Number:	001556943VES

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Transporter Line Number: 2
Transporter EPA ID: NJD054126164
Transporter Name: Freehold Cartage Inc

Waste Line:
Manifest Tracking Number: 001556943VES
Waste Line Number: 1
U.S. DOT Hazardous Indicator: Y
U.S. DOT ID Number: UN3432
U.S. DOT Description: Un3432, Waste Polychlorinated Biphenyls, Solid, (Lead Pipe Pieces & Oily Debris W/>50-Ppm Pcb'S), 9, Ii, Rq (1-Lb/Pcb'S/B007; 10-Lbs/D008) **(Steam# 15498)
Non-Hazardous Waste Description: Not reported
Number of Containers: 1
Container Type Code: DF
Container Type Description: Fiberboard or plastic drums, barrels, kegs
Waste Quantity: 36
Quantity Unit of Measure Code: K
Quantity Unit of Measure Description: Kilograms
Waste Quantity, in Tons: 0.039689977
Acute Waste Quantity, in Tons: 0
Non-Acute Waste Quantity, in Tons: 0.039689977
Waste Quantity, in Kilograms: 36
Acute Waste Quantity, in Kilograms: 0
Non-Acute Waste Quantity, in Kilorgrams: 36
Management Method Code: H141
Management Method Description: STORAGE, BULKING AND/OR TRANSFER OFF SITE
Waste Residue Indicator: N
Quantity Discrepancy Indicator: N
Waste Type Discrepancy Indicator: N
Waste Density: Not reported
Waste Density Unit of Measure Code: Not reported
Waste Density Unit of Measure Description: Not reported
Form Code: Not reported
Form Code Description: Not reported
Source Code: Not reported
Source Code Description: Not reported
Waste Minimization Code: Not reported
Waste Minimization Code Description: Not reported
Consent Number: Not reported
EPA Waste Indicator: Y
Federal Waste Codes: D008
Quantity Haz Kg: 36
Quantity Haz Tons: 0.039689977
Quantity Non Haz Kg: 0
Quantity Non Haz Tons: 0
State Waste Codes: NY-B, NY-B007

Manifest Tracking Number: 001556943VES
Waste Line Number: 2
U.S. DOT Hazardous Indicator: Y
U.S. DOT ID Number: UN3432
U.S. DOT Description: Un3432, Polychlorinated Biphenyls, Solid, (Debris >50ppm Pcb'S: Dirt, Ppe, Poly, Rags), 9, Iii, Rq (1-Lb/Pcb'S/B007) **(Steam#15499)
Non-Hazardous Waste Description: Not reported
Number of Containers: 1
Container Type Code: DM

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Container Type Description:	Metal drums, barrels, kegs
Waste Quantity:	7
Quantity Unit of Measure Code:	K
Quantity Unit of Measure Description:	Kilograms
Waste Quantity, in Tons:	0.0077174953
Acute Waste Quantity, in Tons:	0
Non-Acute Waste Quantity, in Tons:	0.0077174953
Waste Quantity, in Kilograms:	7
Acute Waste Quantity, in Kilograms:	0
Non-Acute Waste Quantity, in Kilorgrams:	7
Management Method Code:	H141
Management Method Description:	STORAGE, BULKING AND/OR TRANSFER OFF SITE
Waste Residue Indicator:	N
Quantity Discrepancy Indicator:	N
Waste Type Discrepancy Indicator:	N
Waste Density:	Not reported
Waste Density Unit of Measure Code:	Not reported
Waste Density Unit of Measure Description:	Not reported
Form Code:	Not reported
Form Code Description:	Not reported
Source Code:	Not reported
Source Code Description:	Not reported
Waste Minimization Code:	Not reported
Waste Minimization Code Description:	Not reported
Consent Number:	Not reported
EPA Waste Indicator:	N
Federal Waste Codes:	Not reported
Quantity Haz Kg:	0
Quantity Haz Tons:	0
Quantity Non Haz Kg:	7
Quantity Non Haz Tons:	0.0077174953
State Waste Codes:	NJ-ID27, NY-B, NY-B007

NJ MANIFEST:

EPA ID:	NYD982271918
Name:	SYRACUSE UNIVERSITY STEAM ST
Address:	500 E TAYLOR ST.
City,State,Zip:	SYRACUSE, NY 13244
County:	Not reported
Mailing Address:	500 E TAYLOR ST.
Mailing City,State,Zip:	SYRACUSE 13244
Telephone:	3154434188
Emergency Telephone:	3154434188
Contact:	Not reported
Comments:	Not reported
SIC Code:	Not reported
County:	00
Municipal:	00
Previous EPAID:	Not reported
Generator Flag:	X
Transporter Flag:	Not reported
TSDF Flag:	Not reported
Name Change:	Not reported
Date Change:	000000

Manifest Data:

EPA ID:	NYD982271918

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Manifest Number:	NJA3092111
Date Shipped:	07/16/2004
TSDF EPA ID:	NJD980536593
Transporter EPA ID:	NJD080631369
Transporter 2 EPA ID:	NJD054126164
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/16/2004
Date Trans2 Transported Waste:	07/22/2004
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/23/2004
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	09030422
Was Load Rejected:	N
Reason Load Was Rejected:	Not reported

EPA ID:	NYD982271918
Manifest Number:	000380452VES
Date Shipped:	02/05/2010
TSDF EPA ID:	NJD980536593
Transporter EPA ID:	NJD080631369
Transporter 2 EPA ID:	NJD054126164
Transporter 3 EPA ID:	NJD000692061
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	02/05/2010
Date Trans2 Transported Waste:	02/11/2010
Date Trans3 Transported Waste:	02/16/2010

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	02/16/2010
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	N
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D009
Hand Code:	H141
Quantity:	1
Unit:	P

EPA ID:	NYD982271918
Manifest Number:	NJA3091700
Date Shipped:	07/08/2005
TSDF EPA ID:	NJD980536593
Transporter EPA ID:	NJD080631369
Transporter 2 EPA ID:	NJD054126164
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/08/2005
Date Trans2 Transported Waste:	07/14/2005
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/15/2005
TSDF EPA Facility Name:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	08230521
Was Load Rejected:	N
Reason Load Was Rejected:	Not reported

EPA ID:	NYD982271918
Manifest Number:	000570816VES
Date Shipped:	10/6/2011
TSDF EPA ID:	NJD980536593
Transporter EPA ID:	NJD080631369
Transporter 2 EPA ID:	NJD054126164
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	Not reported
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **1000145092**

Waste Code:	D009
Hand Code:	H141
Quantity:	17.00
Unit:	Pounds
Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H141
Quantity:	124.00
Unit:	Pounds
EPA ID:	NYD982271918
Manifest Number:	NJA3092105
Date Shipped:	03/11/2004
TSDF EPA ID:	NJD002454544
Transporter EPA ID:	NJD080631369
Transporter 2 EPA ID:	NJD054126164
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	03/11/2004
Date Trans2 Transported Waste:	03/16/2004
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	03/17/2004
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	04020421
Was Load Rejected:	N
Reason Load Was Rejected:	Not reported

B13 **SU CHILLED WATER PLANT** **NY AST** **S100346926**
SE **500 E. TAYLOR STREET** **NY CBS AST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.012 mi.
61 ft. **Site 10 of 16 in cluster B**

Relative:
Higher

Actual:
406 ft.

AST:

Name:	SU CHILLED WATER PLANT
Address:	500 E. TAYLOR STREET
City,State,Zip:	SYRACUSE, NY 13202
Region:	STATE
DEC Region:	7
Site Status:	Unregulated/Closed
Facility Id:	7-000281
Program Type:	CBS
UTM X:	406826.97609
UTM Y:	4765824.13209
Expiration Date:	N/A
Site Type:	School

Tank Info:

Tank Number:	002
Tank Id:	192050
Tank Location:	Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.
Tank Type:	Stainless Steel Alloy
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	10/01/1996
Capacity Gallons:	1100
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	11/01/1999
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

Tank Number:	003
Tank Id:	192051
Tank Location:	Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.
Tank Type:	Plastic
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	10/01/1996
Capacity Gallons:	500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	11/01/1999
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

SU CHILLED WATER PLANT (Continued) **S100346926**

CBS AST:

CBS Number:	7-000281
ICS Number:	Not reported
PBS Number:	7-180602
MOSF Number:	Not reported
SPDES Number:	Not reported
Facility Status:	IN SERVICE
Facility Type:	G
Telephone:	(315) 443-4188
Facility Town:	SYRACUSE (C)
Region:	STATE
Expiration Date:	10/09/2000
Total Capacity of All Active Tanks(gal):	0
Operator:	SYRACUSE UNIVERSITY
Emergency Contact:	TOM REDDINGER
Emergency Phone:	(315) 443-4188
Owner Name:	SYRACUSE UNIVERSITY
Owner Address:	SKYTOP ROAD
Owner City,St,Zip:	SYRACUSE, NY 13244
Owner Telephone:	(315) 443-8230
Owner Type:	Corporate/Commercial
Owner Sub Type:	Not reported
Mail Name:	SYRACUSE UNIVERSITY
Mail Contact Addr:	EHO O29 LYMAN HALL
Mail Contact Addr2:	100 COLLEGE PLACE
Mail Contact Contact:	JAMES MCCUMBER
Mail Contact City,St,Zip:	SYRACUSE, NY 13244
Mail Phone:	(315) 443-4132

Tank Id:	003
CAS Number:	7681529
Federal ID:	Not reported
Tank Status:	0
Install Date:	10/96
Tank Closed:	11/99
Capacity (Gal):	500
Chemical:	Sodium hypochlorite
Tank Location:	Indoors, Aboveground
Tank Type:	Fiberglass reinforced plastic [FRP]
Total Tanks:	0
Tank Secret:	False
Tank Secondary Containment:	01
Tank Error Status:	No Missing Data
Date Entered:	10/09/1996
Certified Date:	08/31/1998
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None,None
Pipe Location:	Aboveground
Pipe Type:	Double Walled Fiberglass
Pipe Internal:	None
Pipe External:	00
Pipe Flag:	00
Leak Detection:	01
Overfill Protection:	04
Haz Percent:	12
Last Test:	Not reported

SU CHILLED WATER PLANT (Continued) **S100346926**

Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	Not reported
Is It There:	False
Delinquent:	False
Date Expired:	Not reported
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True
Pre-Printed Renewal App Last Printed:	07/05/2000

Tank Id:	002
CAS Number:	7664939
Federal ID:	Not reported
Tank Status:	0
Install Date:	10/96
Tank Closed:	11/99
Capacity (Gal):	1100
Chemical:	Sulfuric acid
Tank Location:	Indoors, Aboveground
Tank Type:	Stainless steel alloy
Total Tanks:	0
Tank Secret:	False
Tank Secondary Containment:	01
Tank Error Status:	No Missing Data
Date Entered:	10/09/1996
Certified Date:	08/31/1998
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	Other
External Protection:	None,None
Pipe Location:	None
Pipe Type:	Steel/Iron
Pipe Internal:	Other
Pipe External:	00
Pipe Flag:	00
Leak Detection:	01
Overfill Protection:	02
Haz Percent:	93
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	Not reported
Is It There:	False
Delinquent:	False
Date Expired:	Not reported
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True
Pre-Printed Renewal App Last Printed:	07/05/2000

B14 **SYRACUSE UNIVERSITY - STEAM STATION** **NY LTANKS** **S111258241**
SE **500 E TAYLOR ST** **NY Spills** **N/A**
< 1/8 **SYRACUSE, NY 13244** **NY AIRS**
0.012 mi.
61 ft. **Site 11 of 16 in cluster B**

Relative:
Higher

Actual:
406 ft.

LTANKS:

Name:	SYR. U. STEAM STATION
Address:	500 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8605131 / 1988-01-15
Facility ID:	8605131
Site ID:	229011
Spill Date:	1986-11-11
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1988-01-15
SWIS:	3415
Investigator:	WATKINS
Referred To:	Not reported
Reported to Dept:	1986-11-12
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1986-11-25
Spill Record Last Update:	1988-02-10
Spiller Name:	Not reported
Spiller Company:	SYRACUSE U. STEAM STATION
Spiller Address:	500 E. TAYLER ST.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	267351
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was AW / / : LEAK ON TOP OF TANK. WILL ABANDON TANK BY END OF YR.WILL SEND LETTER WHEN THE WORK BEGINS.
Remarks:	ATLANTIC TESTING DID TANK TEST. LOSING 2 IN MINUTES. ALSO SEE SPILL #86-5148. DUPLICATION.

All Materials:

Site ID:	229011
Operable Unit ID:	902093
Operable Unit:	01
Material ID:	474334
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

Name:	SYRACUSE U. STEAM STATION
Address:	500 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8605148 / 1988-01-15
Facility ID:	8605148
Site ID:	229012
Spill Date:	1986-11-11
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1988-01-15
SWIS:	3415
Investigator:	WATKINS
Referred To:	Not reported
Reported to Dept:	1986-11-12
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1986-11-25
Spill Record Last Update:	1988-02-10
Spiller Name:	Not reported
Spiller Company:	SYRACUSE UNIV. STEAM STA.
Spiller Address:	500 E. TAYLER ST.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	267351
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was AW
Remarks:	1000 GAL. TANK. FAILURE RATE .8 GALS. PER HOUR. TANK 55 YEARS OLD. SEE ALSO SPILL #86-5131. DUPLICATION.

All Materials:

Site ID:	229012
Operable Unit ID:	902111
Operable Unit:	01
Material ID:	474349
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Oxygenate: Not reported

SPILLS:

Name:	SYRACUSE UNIVERSITY CHILLED WATER PLANT
Address:	500 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0407665 / 2004-10-13
Facility ID:	0407665
Facility Type:	ER
DER Facility ID:	267351
Site ID:	332190
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2004-10-11
Investigator:	BFMATTHE
Referred To:	Not reported
Reported to Dept:	2004-10-11
CID:	72
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-10-12
Spill Record Last Update:	2004-11-22
Spiller Name:	JIM MCCUMBER
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	JIM MCCUMBER
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	SPOKE TO JIM MCCUMBER THEY WOULD LIKE TO NEUTRALIZE AND CLEAN UP. SOME OF SPILL WENT ONTO STATE PROPERTY AND WANTED TO VERIFY IT WAS OK TO ENTER PROPERTY. SPOKE TO DICK BRAZELL AND HE AUTHORIZED. CLEANUP COMPLETE.
Remarks:	Punctured polydrum caused about 20 gallons of sodium hypoclorite (12%) to spill onto asphalt and stone driving area. Spill contained, also went onto adjacent p

All Materials:

Site ID:	332190
Operable Unit ID:	1094447
Operable Unit:	01
Material ID:	574553
Material Code:	0124A
Material Name:	sodium hypochlorite
Case No.:	07681529
Material FA:	Hazardous Material

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Quantity:	20.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	SYRACUSE U STEAM STATION
Address:	500 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8910992 / 1990-07-09
Facility ID:	8910992
Facility Type:	ER
DER Facility ID:	267351
Site ID:	161895
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	1990-02-17
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	1990-02-19
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	1990-02-19
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1990-03-07
Spill Record Last Update:	1995-03-06
Spiller Name:	Not reported
Spiller Company:	SYRACUSE UNIV
Spiller Address:	500 E TAYLOR
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0394104
Longitude:	-76.1437744
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was HW 07/09/90: VENT LINE LEAKED ON NEWLY INSTALLED UNDERGROUND TANKS. INTERFACE CLEANED UP SMALL AMOUNT OF CONTAMINATED SOIL AND DISPOSED.
Remarks:	VENT LINE RUPTURED.STEAM PALNT PERSONNEL CLEAN UP.

All Materials:

Site ID:	161895
Operable Unit ID:	937992
Operable Unit:	01
Material ID:	440539
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Quantity:	25.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	SYRACUSE UNVI/ STEAM STATION
Address:	500 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1206833 / 2012-12-04
Facility ID:	1206833
Facility Type:	ER
DER Facility ID:	424153
Site ID:	469851
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	C4
SWIS:	3415
Spill Date:	2012-10-11
Investigator:	MJROMOCK
Referred To:	Not reported
Reported to Dept:	2012-10-11
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2012-10-11
Spill Record Last Update:	2012-12-04
Spiller Name:	BECKY PONZA
Spiller Company:	SYRACUSE UNVI
Spiller Address:	500 EAST TAYLOR ST
Spiller Company:	999
Contact Name:	BECKY PONZA
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	10/11/2012 - Repairs being done to underground storage tanks. Groundwater being removed from excavtion to effect repairs. 10/25/2012 - Spoke w/ B. Ponza at SU. Contaminated water is being stored on site in frac tank. Water being sampled prior to discharge to sanitary sewer. 11/19/2012 - Rec'd e-mail documenting recent activities regarding GW discharge to Onondaga County sewer. 12/4/2012 - Called B.Ponza at SU. Repairs to tank monitoring system completed.
Remarks:	sheen observed during excavation,tanks present, unk cause, c/u and investigation ongoing

All Materials:

Site ID:	469851
Operable Unit ID:	1219737

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Operable Unit: 01
Material ID: 2218270
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Groundwater
Oxygenate: Not reported

AIRS:
Name: SYRACUSE UNIVERSITY - STEAM STATION
Address: 500 E TAYLOR ST
City,State,Zip: SYRACUSE, NY 13244
DECID: 7311500204
Process ID: Not reported
Latitude: 43.039272869
Longitude: 76.143121261
FIPS Code: Not reported
Auth Type Code: ATV

Permit Status: Expired
Auth Status Code: Not reported
Emissions: Not reported
Issue date: 02/03/2012
Expired Date: 02/02/2017
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

Permit Status: Issued
Auth Status Code: Not reported
Emissions: Not reported
Issue date: 06/22/2021
Expired Date: 06/21/2026
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

AIRS Detail:
DECID: 7311500204
Facility Name: SYRACUSE UNIVERSITY - STEAM STATION
Auth Type: ATV

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: CARBON MONOXIDE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: VOC
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PARTICULATES
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PM-10
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: TOTAL HAP
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: UNSPECIATED PARTICULATES (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: VOC
Amount(Lbs/Yr): Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	LEAD
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	PARTICULATES
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	PM-10
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	TOTAL HAP
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	UNSPECIATED PARTICULATES (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: VOC
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: LEAD
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PARTICULATES
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PM-10
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: TOTAL HAP
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: Not reported
CAS #: Not reported
Contaminant: UNSPECIATED PARTICULATES (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: VOC
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: LEAD
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PARTICULATES
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PM-10
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: Not reported
Contaminant: TOTAL HAP
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: UNSPECIATED PARTICULATES (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: VOC
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: LEAD
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PARTICULATES
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PM-10
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: TOTAL HAP
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: UNSPECIATED PARTICULATES (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: VOC
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: LEAD
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PARTICULATES
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PM-10

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: TOTAL HAP
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: UNSPECIATED PARTICULATES (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: LEAD
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 0.00450768

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 0.00676152

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 6.1168799999999999E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 5.1211799999999999E-4

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	5.0711400000000002E-4

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	4.5876599999999999E-4

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000086737
Contaminant:	FLUORENE
Amount(Lbs/Yr):	7.1363600000000002E-4

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	25538

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	7.3912300000000002

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	3.4141200000000001E-3

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	0.220108

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	0.031444

Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.1081138

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.17185529999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 8.5353000000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 512.11800000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 458.76600000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.53454800000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.95788200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 654.37300000000005

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2016
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 455.21600000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.3807599999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 4.8366700000000004E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 3.3807599999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 4.55938

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 94.331999999999994

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 170.70599999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 152.922

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 0.01320648

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 13206.48

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000109660

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: PENTANE
Amount(Lbs/Yr): 739.726

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 507.11399999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 18866400

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 535.22699999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 450.76799999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 0.33016200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 361.60599999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 1.8866400000000001E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	2.8299599999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	2162.2759999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	19725
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	139.40989999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	0.30990299999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.13363700000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.24183350000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.33016200000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	1.251844

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 1.1214280000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 0.00188664

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.14225499999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 5.9743600000000001E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 7.3972599999999999E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 6.6266199999999997E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 3.7732800000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.15547069999999999

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 662.66200000000003

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 0.00140865

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 0.59163299999999996

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 21.129750000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 6.8282400000000002E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 3.0584399999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 2.6727399999999998E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 4.3327900000000004E-3

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 0.000440216

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 345.88400000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 138.04769999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 8.1701700000000006

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.31296099999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.35681800000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 0.02366532

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 4.0877200000000002E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.28035700000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 0.69176800000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 1.2396119999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.14086499999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.1070574

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 23665.32

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 6.1168799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 9.5904199999999995E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000205992

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 408.77199999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 1.4225500000000001E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 647.97900000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 586.20100000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 487.38200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 881.98099999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 19.11525

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	0.00478941
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000056495
Contaminant:	3-METHYLCHOLANTHRENE
Amount(Lbs/Yr):	5.1211799999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	0.00377328
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	0.305844
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000191242
Contaminant:	BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr):	1.8866400000000001E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000056495
Contaminant:	3-METHYLCHOLANTHRENE
Amount(Lbs/Yr):	5.0711400000000002E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000086737
Contaminant:	FLUORENE
Amount(Lbs/Yr):	7.8884400000000003E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	24957
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	6.1168799999999999E-3

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.2394705
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.21663950000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.59163299999999996
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	7.8609999999999999E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	9.6850599999999995E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439976
Contaminant:	MERCURY
Amount(Lbs/Yr):	7.3249800000000004E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	0.31296099999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	23898.84
Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 21409.080000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 0.00084519

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 6.8282399999999995E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 732.49800000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 790.09699999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 2162.2759999999998

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year:	2016
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	19725
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	139.40989999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	0.30990299999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.13363700000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.24183350000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.33016200000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	1.251844
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	1.1214280000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 0.00188664

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.14225499999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 5.9743600000000001E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 7.3972599999999999E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 6.6266199999999997E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 3.7732800000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.15547069999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 662.66200000000003

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000129000

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: PYRENE
Amount(Lbs/Yr): 0.00140865

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 0.59163299999999996

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 21.129750000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 6.8282400000000002E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 3.0584399999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 2.6727399999999998E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 4.3327900000000004E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 0.000440216

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 010024972
Contaminant: NITROUS OXIDE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	345.88400000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	138.04769999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	8.1701700000000006
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	0.31296099999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	0.35681800000000002
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	0.02366532
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439976
Contaminant:	MERCURY
Amount(Lbs/Yr):	4.0877200000000002E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	0.28035700000000002
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	0.69176800000000005

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	1.2396119999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	0.14086499999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	0.1070574
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	23665.32
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	6.1168799999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	9.5904199999999995E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	5.1211799999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	408.77199999999999
Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 1.4225500000000001E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 647.97900000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 586.20100000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 487.38200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 881.98099999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 19.11525

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 0.00478941

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2016
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 0.00377328

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.305844

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 1.8866400000000001E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 7.8884400000000003E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 24957

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 6.1168799999999999E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.2394705

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.21663950000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.59163299999999996

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 7.8609999999999999E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 9.6850599999999995E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 7.3249800000000004E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.31296099999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 23898.84

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 21409.080000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000120127

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: ANTHRACENE
Amount(Lbs/Yr): 6.8282399999999995E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 732.49800000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 790.09699999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 0.00084519

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 11.791499999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 21.338249999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 619.80600000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007664417
Contaminant: AMMONIA

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	77.037800000000004
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	124.88630000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	0.00377328
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	0.00676152
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	0.17294200000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	0.28035700000000002
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	0.398314
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	0.39442199999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.36160599999999998

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.30990299999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.59747099999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 5.0973999999999998E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 4.7165999999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.86655800000000005

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 33807600

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 7.8609999999999997E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 330.16199999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 597.471

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 591.63300000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.0584399999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.0584399999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 0.59747099999999997

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year:	2016
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	0.53522700000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	2141.1480000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	1937.0119999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	6.8282400000000002E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	625.92200000000003
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	560.71400000000006
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	0.02140908
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	8.2507900000000003
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 282.99599999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.17355110000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 30584400

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 251.55199999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 1.8866400000000001E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000053703

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.4141199999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 4.0779199999999996E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.188664

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.34141199999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 7.9662799999999996E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY075025
Contaminant: PM 2.5

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	1194.8720000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	27012
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.65437299999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.64797899999999997
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.58620099999999997
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	169.03800000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	0.00338076
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	3.0584399999999999E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	2.3898840000000001E-2

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.17294200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.53522700000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 5.6902000000000001E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.056346

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.12743499999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 7.6460999999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 6.7615199999999996E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.96733400000000003

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 0.00127435

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 34141200

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 873.36300000000006

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 407.79199999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.3807599999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.4141199999999998E-4

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 3.4141199999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 2.5155199999999998E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.33807599999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 4.5521600000000004E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 0.00450768

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 0.00676152

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 6.1168799999999999E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 7.1363600000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 25538

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 7.3912300000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440417

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: BERYLLIUM
Amount(Lbs/Yr): 3.4141200000000001E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.220108

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.031444

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.1081138

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.17185529999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 8.5353000000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 512.11800000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 458.76600000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000108883
Contaminant: TOLUENE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr): 0.53454800000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.95788200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 654.37300000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 455.21600000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.3807599999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 4.8366700000000004E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 3.3807599999999998E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 4.5876599999999999E-4

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 4.55938

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 94.331999999999994

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 170.70599999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 152.922

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 0.01320648

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 13206.48

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 5.1211799999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 739.726

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 507.11399999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 18866400

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 535.22699999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 450.76799999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 0.33016200000000001

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year:	2016
CAS #:	000074828
Contaminant:	METHANE
Amount(Lbs/Yr):	361.60599999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	1.8866400000000001E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	11.791499999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	21.338249999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	619.80600000000004
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	77.037800000000004
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	124.88630000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	0.00377328
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 0.00676152

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.17294200000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.28035700000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.398314

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.39442199999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.36160599999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.30990299999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.59747099999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440382

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant:	ARSENIC
Amount(Lbs/Yr):	5.0973999999999998E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	5.0711400000000002E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	4.5876599999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	4.7165999999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	5.0711400000000002E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000074986
Contaminant:	PROPANE
Amount(Lbs/Yr):	407.79199999999997
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	3.3807599999999998E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	3.4141199999999998E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000191242
Contaminant:	BENZO[G,H,I]PERYLENE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	3.4141199999999998E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000057976
Contaminant:	7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr):	2.5155199999999998E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	0.33807599999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000193395
Contaminant:	INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr):	2.8299599999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000193395
Contaminant:	INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr):	5.1211799999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000193395
Contaminant:	INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr):	4.5876599999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000057976
Contaminant:	7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr):	4.5521600000000004E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	0.86655800000000005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	33807600

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 7.8609999999999997E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 330.16199999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 597.471

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 591.63300000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.0584399999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.0584399999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 0.59747099999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 0.53522700000000001

Issue Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2016
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 2141.1480000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 1937.0119999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 6.8282400000000002E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 625.92200000000003

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 560.71400000000006

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 0.02140908

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 8.2507900000000003

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 4.5876599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year:	2016
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	5.1211799999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	4.5876599999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	282.99599999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	0.17355110000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	30584400
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000074986
Contaminant:	PROPANE
Amount(Lbs/Yr):	251.55199999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	1.8866400000000001E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	3.4141199999999998E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 5.0711400000000002E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 2.8299599999999999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 4.0779199999999996E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.188664

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.34141199999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 7.9662799999999996E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 1194.8720000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 0NY210000

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 27012

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.65437299999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.64797899999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.58620099999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 169.03800000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 0.00338076

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 3.0584399999999999E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 2.3898840000000001E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007439987
Contaminant: MOLYBDENUM

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	0.17294200000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.53522700000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	5.6902000000000001E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	0.056346
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	0.12743499999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	5.0711400000000002E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	7.6460999999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	2.8299599999999999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	6.7615199999999996E-4

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	0.96733400000000003
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000129000
Contaminant:	PYRENE
Amount(Lbs/Yr):	0.00127435
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	34141200
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000074840
Contaminant:	ETHANE
Amount(Lbs/Yr):	873.36300000000006
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000057976
Contaminant:	7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr):	0.015103890336
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	1.3939565605
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000074828
Contaminant:	METHANE
Amount(Lbs/Yr):	2187.9118
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000074840
Contaminant:	ETHANE
Amount(Lbs/Yr):	2943.233
Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2012
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 1021.1002366

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 0.0016991876628

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 0.010849190014

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 0.0026431808088

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.38929446519

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 0.022655835504

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 1340.1940605

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 2.1698380027

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year:	2012
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	1659.2878844
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	1148.7377661
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	0.0022655835504
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	113931600
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000129000
Contaminant:	PYRENE
Amount(Lbs/Yr):	0.00471996573
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000191242
Contaminant:	BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr):	0.0011327917752
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000193395
Contaminant:	INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr):	0.0016991876628
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	0.0016991876628
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 0.002893561938

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 0.0011487377661

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 0.0011487377661

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 79849.87

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.496453623

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.35899109548

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 0.24549686796

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 1.0383924606

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440020

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 1.9827375066

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.1888807392

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 4.1535698424

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 0.011376792752

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 1.0386075106

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 1.3314436044

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 0.079295424264

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 1.1297103948

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440473
Contaminant: CHROMIUM

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	1.4550808297
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	48.802473589
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	0.00076582517743
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	0.00076582517743
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000056495
Contaminant:	3-METHYLCHOLANTHRENE
Amount(Lbs/Yr):	0.0016991876628
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	0.0011487377661
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.8025114741
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	2.1711842358
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	27.375879434

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	1124.878
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007446119
Contaminant:	SULFUR TRIOXIDE
Amount(Lbs/Yr):	22.287
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	480.8607
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	0.022949085504
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	2093.829
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	0.76582517743
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	7190.5744096
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	0NY075105
Contaminant:	UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	30.266609133
Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2012
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 172417.925

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 5.6548375

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 0.086239192181

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.87286993231

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 2.3613112145

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 29.773195403

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 627.04812

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007446119
Contaminant: SULFUR TRIOXIDE
Amount(Lbs/Yr): 0.301302

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2012
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 534.1513

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 0.025168369195

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 2280.8164

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.83288720965

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 7831.8427783

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 54.557304646

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 188915.38

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 10.19317

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 53.746970603

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 0.00083288720965

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 0.00083288720965

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000056495
Contaminant: 3-METHYLCHOLANTHRENE
Amount(Lbs/Yr): 0.0018479826896

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 0.0012493308145

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 0.016426512796

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 1.5544626169

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 2382.52284

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000074840

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: ETHANE
Amount(Lbs/Yr): 3200.967

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 1110.5162795

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 0.0018479826896

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 0.01179923547

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 0.0028746397394

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.42338433157

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 0.024639769195

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 1457.5526169

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000108883
Contaminant: TOLUENE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	2.359847094
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	1804.5889542
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	1249.3308145
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	0.0024639769195
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	123908400
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000129000
Contaminant:	PYRENE
Amount(Lbs/Yr):	0.0051332852489
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000191242
Contaminant:	BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr):	0.0012319884597
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000193395
Contaminant:	INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr):	0.0018479826896
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	0.0018479826896

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	0.0031909771493

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	0.0012493308145

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	0.0012493308145

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	86912.08

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	0.55741376489

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	0.39062303891

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439976
Contaminant:	MERCURY
Amount(Lbs/Yr):	0.26703655294

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	1.1293227548

Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2012
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 2.1566141245

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.20547941795

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 4.517291019

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 0.012407984597

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount(Lbs/Yr): 9.6044999999999995E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.122680431738698

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 0.49072172695479299

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.12510231973869801

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year:	2011
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	0.16168889130379799
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	9.3683238782278702E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	9.4798515434448699E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.25651362999909599
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	3.2343022912929502
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	54.963299999999997
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	0NY075105
Contaminant:	UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	5.5787649903999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	81.900133838282699
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 2.3192316622719198

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 2583.991

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.68393840356470004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 3.7077329098688199

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 1956.7171305187901

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 134518897.91999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 96502.540548000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.55959942886778602

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007439965

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: MANGANESE
Amount(Lbs/Yr): 0.82080841875767696

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 0.29947866859083

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 2.4031236877058202

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.237759257654787

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 1.3489231851164201E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 812.24250840000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 4.8275508127604803E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 2472.7739999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 025321226
Contaminant: DICHLOROBENZENE

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	1.3004780870125201
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	8687.3071200824907
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	209559.53279999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	0NY998100
Contaminant:	UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	16339.298932142199
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	9.1111687012523601E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	9.2442787012523599E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000056495
Contaminant:	3-METHYLCHOLANTHRENE
Amount(Lbs/Yr):	2.00749797390597E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	1.4137873051878601E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000057976
Contaminant:	7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr):	0.00178444264347197

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000074840
Contaminant:	ETHANE
Amount(Lbs/Yr):	347.72699999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000074986
Contaminant:	PROPANE
Amount(Lbs/Yr):	120.637449350032
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000075070
Contaminant:	ACETALDEHYDE
Amount(Lbs/Yr):	0.00258479
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000083329
Contaminant:	ACENAPHTHENE
Amount(Lbs/Yr):	2.0553519222513299E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000085018
Contaminant:	PHENANTHRENE
Amount(Lbs/Yr):	0.00138085089934408
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000086737
Contaminant:	FLUORENE
Amount(Lbs/Yr):	4.1068135638818999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	2.6766639652079601E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000106978
Contaminant:	BUTANE
Amount(Lbs/Yr):	158.33665227191599
Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2011
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount(Lbs/Yr): 8.2047270000000002E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000107028
Contaminant: ACROLEIN
Amount(Lbs/Yr): 0.000311725

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 196.03585519380101

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000115071
Contaminant: PROPYLENE
Amount(Lbs/Yr): 8.6946000000000002E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 2.7396828971838901E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 5.7374690869702104E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 1.3548109648161901E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000193395
Contaminant: INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr): 2.0201349602653199E-4

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2011
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 2.0108379703006999E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 3.6022866796847202E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 1.3623943051878601E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 1.3690673051878601E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 7.9926399999999995E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 610.86479999999995

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 2.4824200000000001E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075005
Contaminant: PM-10
Amount(Lbs/Yr): 7593.9326000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 279752.04800000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 5495.2455200000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075100
Contaminant: UNSPECIATED PARTICULATES (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 7594.3346000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 7593.6310999999996

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 507.38920000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 5.4945606817175701E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 278.59458891855701

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 1.1447001420244901E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000191242

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 2.7472803408587802E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 4.1209205112881703E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 6.9677408521469602E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 2.78594588918557E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 2.78594588918557E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 19357.472000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.118451614202449

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 8.7041450793861497E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439976
Contaminant: MERCURY

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr): 5.9533887385273598E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.251834031245388

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.480830939650287

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 4.5801277680979698E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 1.00733612498155

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 2.7551803408587799E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.25186879124538802

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.32210867976685797

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 1.9230962386011501E-2

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.19461798414416401
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.52656206533126704
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	6.6392734637420601
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	227.89879999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007446119
Contaminant:	SULFUR TRIOXIDE
Amount(Lbs/Yr):	3.6023999999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	115.35442
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	5.5419606817175698E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	0.185729725945704
Issue Date:	Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Expiration Date: Not reported
Year: 2009
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 1742.56701587723

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 4.8921702739999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 64548.080000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 0.91403000000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 11.7597878716065

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 1.85729725945704E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 1.85729725945704E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 2.78594588918557E-4

Issue Date: Not reported
Expiration Date: Not reported

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Year: 2009
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 0.33371702040498302

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 530.27596000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 713.7998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 247.63963459427299

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 4.1209205112881703E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 2.6311711175641501E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 6.4103207953371602E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 9.4412610689066395E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	5.4945606817175703E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000106978
Contaminant:	BUTANE
Amount(Lbs/Yr):	325.02702040498298
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	0.526234223512829
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	402.41440621569302
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	27630960
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	74.955522000000002
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	1.2199999999999999E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	0.60943879999999995
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000106467

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Contaminant: BENZENE, 1,4-DICHLORO-
Amount(Lbs/Yr): 1.198896

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 3.3968720000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 1798.3440000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 83924.729999999996

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.50004652000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.37998808000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 0.25992964000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 2.0982368400000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440382
Contaminant: ARSENIC

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Amount(Lbs/Yr):	0.20004111999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	1.2158840000000001E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	1.09915684
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	1.3988808399999999

AIRS Emissions:

County:	ONONDAGA
Municipality:	SYRACUSE
Facility ID:	7311500204
Facility Name:	SYRACUSE UNIVERSITY - STEAM STATION
SIC Code:	8221
Year:	2023
VOC(tons):	10.95
NOx(tons):	49.02
Co(tons):	41.61
Co2(tons):	53707.19
Particulates:	3.54
PM10(tons):	0
PM2.5(tons):	3.52
HAPS:	0.83
So2:	0.4
Year:	2022
VOC(tons):	5.32
NOx(tons):	50.23
Co(tons):	41.44
Co2(tons):	59194.8
Particulates:	3.75
PM10(tons):	0
PM2.5(tons):	3.73
HAPS:	0.89
So2:	0.3
Year:	2021
VOC(tons):	4.27
NOx(tons):	48.32
Co(tons):	40.47
Co2(tons):	57812.4

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

Particulates:	3.66
PM10(tons):	0.01
PM2.5(tons):	3.64
HAPS:	0.91
So2:	0.29
Year:	2020
VOC(tons):	9.6
NOx(tons):	53.52
Co(tons):	44.38
Co2(tons):	61167.89
Particulates:	3.98
PM10(tons):	0
PM2.5(tons):	3.96
HAPS:	0
So2:	0.42
Year:	2019
VOC(tons):	2.27
NOx(tons):	54.04
Co(tons):	45.11
Co2(tons):	64440.6
Particulates:	0.02
PM10(tons):	0
PM2.5(tons):	4.06
HAPS:	0
So2:	0.32
Year:	2018
VOC(tons):	2.18
NOx(tons):	51.79
Co(tons):	43.33
Co2(tons):	61899
Particulates:	3.92
PM10(tons):	0
PM2.5(tons):	3.9
HAPS:	0
So2:	0.31
Year:	2017
VOC(tons):	9.05
NOx(tons):	58.04
Co(tons):	44.71
Co2(tons):	62430.76
Particulates:	4.24
PM10(tons):	0
PM2.5(tons):	4.22
HAPS:	0
So2:	0.59
Year:	2016
VOC(tons):	3.08
NOx(tons):	48.62
Co(tons):	41.09
Co2(tons):	58699.8
Particulates:	3.74
PM10(tons):	0

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

PM2.5(tons):	3.72
HAPS:	0
So2:	0.29
Year:	2015
VOC(tons):	2.14
NOx(tons):	50.59
Co(tons):	42.44
Co2(tons):	60684.56
Particulates:	3.86
PM10(tons):	0.02
PM2.5(tons):	3.82
HAPS:	0
So2:	0.31
Year:	2014
VOC(tons):	10.13
NOx(tons):	107.69
Co(tons):	48.17
Co2(tons):	79011.04
Particulates:	4.04
PM10(tons):	0
PM2.5(tons):	4.02
HAPS:	0
So2:	0.32
Year:	2013
VOC(tons):	2.85
NOx(tons):	94.46
Co(tons):	43.46
Co2(tons):	61954.2
Particulates:	3.95
PM10(tons):	3.95
PM2.5(tons):	3.92
HAPS:	0
So2:	0.31
Year:	2012
VOC(tons):	2.61
NOx(tons):	86.21
Co(tons):	39.92
Co2(tons):	56965.8
Particulates:	3.63
PM10(tons):	3.61
PM2.5(tons):	3.6
HAPS:	0
So2:	0.56
Year:	2011
VOC(tons):	9.43
NOx(tons):	104.78
Co(tons):	48.25
Co2(tons):	67259.45
Particulates:	4.35
PM10(tons):	4.35
PM2.5(tons):	4.34
HAPS:	0

SYRACUSE UNIVERSITY - STEAM STATION (Continued) **S111258241**

So2:	0.41
Year:	2010
VOC(tons):	3.69
NOx(tons):	139.88
Co(tons):	41.96
Co2(tons):	66358.57
Particulates:	11.39
PM10(tons):	7.6
PM2.5(tons):	3.8
HAPS:	0
So2:	0.31

B15 **SYRACUSE UNIVERSITY STEAM STATION** **NY UST U004148320**
SE **500 EAST TAYLOR ST** **NY AST N/A**
< 1/8 **SYRACUSE, NY 13202**
0.012 mi.
61 ft. **Site 12 of 16 in cluster B**

Relative:
Higher

Actual:
406 ft.

UST:

Name:	SYRACUSE UNIVERSITY STEAM STATION
Address:	500 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-180602 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	06/18/2027
UTM X:	406857.02521
UTM Y:	4765814.73916
Site Type:	School

Affiliation Records:

Site Id:	44931
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE UNIVERSITY
Contact Type:	DIRECTOR EHSS
Contact Name:	REBECCA J PONZA
Address1:	CROUSE-HINDS HALL - 900 SOUTH CROUSE AVE
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13244-2130
Country Code:	001
Phone:	(315) 443-4132
EMail:	ehss@syr.edu
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2018-12-21

Site Id:	44931
Affiliation Type:	Facility Operator
Company Name:	SYRACUSE UNIVERSITY STEAM STATION
Contact Type:	Not reported
Contact Name:	NATHAN PRIOR - CENTRIO ENERGY
Address1:	Not reported
Address2:	Not reported
City:	Not reported

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

State: NN
Zip Code: Not reported
Country Code: 001
Phone: (315) 443-5105
EMail: Not reported
Fax Number: Not reported
Modified By: KCKEMP
Date Last Modified: 2022-03-15

Site Id: 44931
Affiliation Type: Mail Contact
Company Name: SYRACUSE UNIVERSITY
Contact Type: Not reported
Contact Name: REBECCA J PONZA
Address1: ENVIRONMENTAL HEALTH & SAFETY SERVICES
Address2: 029 LYMAN HALL, 100 COLLEGE PL
City: SYRACUSE
State: NY
Zip Code: 13244-1270
Country Code: 001
Phone: (315) 443-9133
EMail: EHSS@SYR.EDU
Fax Number: Not reported
Modified By: KCKEMP
Date Last Modified: 2020-10-02

Site Id: 44931
Affiliation Type: Emergency Contact
Company Name: SYRACUSE UNIVERSITY
Contact Type: Not reported
Contact Name: SU PUBLIC SAFETY
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (315) 443-2224
EMail: Not reported
Fax Number: Not reported
Modified By: KCKEMP
Date Last Modified: 2013-07-12

Tank Info:

Tank Number: 001
Tank ID: 129267
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 30000
Install Date: 01/01/1963
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

Tightness Test Method: 01
Date Test: 08/01/1985
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)

Tank Number: 002
Tank ID: 129268
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 30000
Install Date: 01/01/1963
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 01
Date Test: 08/01/1985
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
I04 - Overfill - Product Level Gauge (A/G)

Tank Number: 003
Tank ID: 129269
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 15000
Install Date: Not reported
Date Tank Closed: Not reported

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

Tank Number: 005
Tank ID: 129270
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 30000
Install Date: 08/01/1989
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

J02 - Dispenser - Suction Dispenser
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
C03 - Pipe Location - Aboveground/Underground Combination
F04 - Pipe External Protection - Fiberglass
B09 - Tank External Protection - Urethane
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
A00 - Tank Internal Protection - None
E04 - Piping Secondary Containment - Double walled UG
G04 - Tank Secondary Containment - Double-Walled (Underground)

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

B02 - Tank External Protection - Original Sacrificial Anode
F05 - Pipe External Protection - Jacketed

Tank Number:	006
Tank ID:	129271
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	30000
Install Date:	08/01/1989
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
J02 - Dispenser - Suction Dispenser
B09 - Tank External Protection - Urethane
C03 - Pipe Location - Aboveground/Underground Combination
F04 - Pipe External Protection - Fiberglass
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
A00 - Tank Internal Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
B02 - Tank External Protection - Original Sacrificial Anode
E04 - Piping Secondary Containment - Double walled UG
F05 - Pipe External Protection - Jacketed

Tank Number:	007
Tank ID:	129272
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	30000
Install Date:	08/01/1989
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

J02 - Dispenser - Suction Dispenser
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
C03 - Pipe Location - Aboveground/Underground Combination
F04 - Pipe External Protection - Fiberglass
B09 - Tank External Protection - Urethane
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
A00 - Tank Internal Protection - None
E04 - Piping Secondary Containment - Double walled UG
G04 - Tank Secondary Containment - Double-Walled (Underground)
B02 - Tank External Protection - Original Sacrificial Anode
F05 - Pipe External Protection - Jacketed

Tank Number: 008
Tank ID: 129273
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 30000
Install Date: 08/01/1989
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

J02 - Dispenser - Suction Dispenser
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
F04 - Pipe External Protection - Fiberglass
B09 - Tank External Protection - Urethane
C03 - Pipe Location - Aboveground/Underground Combination
K01 - Spill Prevention - Catch Basin
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
A00 - Tank Internal Protection - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
E04 - Piping Secondary Containment - Double walled UG
G04 - Tank Secondary Containment - Double-Walled (Underground)
B02 - Tank External Protection - Original Sacrificial Anode
F05 - Pipe External Protection - Jacketed

AST:
Name: SYRACUSE UNIVERSITY STEAM STATION

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

Address: 500 EAST TAYLOR ST
City,State,Zip: SYRACUSE, NY 13202
Region: STATE
DEC Region: 7
Site Status: Active
Facility Id: 7-180602
Program Type: PBS
UTM X: 406857.02521
UTM Y: 4765814.73916
Expiration Date: 06/18/2027
Site Type: School

Affiliation Records:

Site Id: 44931
Affiliation Type: Facility Owner
Company Name: SYRACUSE UNIVERSITY
Contact Type: DIRECTOR EHSS
Contact Name: REBECCA J PONZA
Address1: CROUSE-HINDS HALL - 900 SOUTH CROUSE AVE
Address2: Not reported
City: SYRACUSE
State: NY
Zip Code: 13244-2130
Country Code: 001
Phone: (315) 443-4132
EMail: ehss@syr.edu
Fax Number: Not reported
Modified By: KCKEMP
Date Last Modified: 2018-12-21

Site Id: 44931
Affiliation Type: Facility Operator
Company Name: SYRACUSE UNIVERSITY STEAM STATION
Contact Type: Not reported
Contact Name: NATHAN PRIOR - CENTRIO ENERGY
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (315) 443-5105
EMail: Not reported
Fax Number: Not reported
Modified By: KCKEMP
Date Last Modified: 2022-03-15

Site Id: 44931
Affiliation Type: Mail Contact
Company Name: SYRACUSE UNIVERSITY
Contact Type: Not reported
Contact Name: REBECCA J PONZA
Address1: ENVIRONMENTAL HEALTH & SAFETY SERVICES
Address2: 029 LYMAN HALL, 100 COLLEGE PL
City: SYRACUSE
State: NY
Zip Code: 13244-1270
Country Code: 001

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

Phone:	(315) 443-9133
EMail:	EHSS@SYR.EDU
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2020-10-02

Site Id:	44931
Affiliation Type:	Emergency Contact
Company Name:	SYRACUSE UNIVERSITY
Contact Type:	Not reported
Contact Name:	SU PUBLIC SAFETY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(315) 443-2224
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2013-07-12

Tank Info:

Tank Number:	009
Tank Id:	129274
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Equipment Records:

	H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
	J02 - Dispenser - Suction Dispenser
	G01 - Tank Secondary Containment - Diking (Aboveground)
	K00 - Spill Prevention - None
	L09 - Piping Leak Detection - Exempt Suction Piping
	B01 - Tank External Protection - Painted/Asphalt Coating
	D01 - Pipe Type - Steel/Carbon Steel/Iron
	A00 - Tank Internal Protection - None
	I05 - Overfill - Vent Whistle
	E99 - Piping Secondary Containment - Other
	F00 - Pipe External Protection - None
	I04 - Overfill - Product Level Gauge (A/G)
	C01 - Pipe Location - Aboveground
Tank Location:	Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	06/01/1990
Capacity Gallons:	275
Tightness Test Method:	-
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	02/25/2019
Register:	True

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U004148320**

Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	#2 fuel oil (on-site consumption)
Tank Number:	010
Tank Id:	214870
Material Code:	0012
Common Name of Substance:	Kerosene [#1 Fuel Oil] (On-Site Consumption)

Equipment Records:

J02 - Dispenser - Suction Dispenser
L00 - Piping Leak Detection - None
D00 - Pipe Type - No Piping
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I01 - Overfill - Float Vent Valve
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
E00 - Piping Secondary Containment - None
F00 - Pipe External Protection - None
C01 - Pipe Location - Aboveground

Tank Location:	Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	12/08/2006
Capacity Gallons:	300
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	10/22/2009
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	kerosene [#1 fuel oil] (on-site consumption)

B16 **SYRACUSE UNIVERSITY STEAM STATION** **NY CBS AST** **U003077914**
SE **500 E. TAYLOR STREET** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.012 mi.
61 ft. **Site 13 of 16 in cluster B**

Relative: **Higher**
Actual: **406 ft.**

CBS AST:

CBS Number:	7-000152
ICS Number:	7-700483
PBS Number:	7-180602
MOSF Number:	Not reported
SPDES Number:	Not reported
Facility Status:	IN SERVICE
Facility Type:	G
Telephone:	(315) 474-8230
Facility Town:	SYRACUSE (C)
Region:	STATE
Expiration Date:	07/18/2003

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U003077914**

Total Capacity of All Active Tanks(gal):	1500
Operator:	JOSEPH BURROUGHS
Emergency Contact:	JOSEPH BURROUGHS
Emergency Phone:	(315) 474-8230
Owner Name:	SYRACUSE UNIVERSITY
Owner Address:	SKYTOP ROAD
Owner City,St,Zip:	SYRACUSE, NY 13244-6400
Owner Telephone:	(315) 443-4188
Owner Type:	Corporate/Commercial
Owner Sub Type:	Not reported
Mail Name:	PROJECT ORANGE ASSOCIATES, L.P.
Mail Contact Addr:	507 PLUM ST
Mail Contact Addr2:	NIAGARA MOHAWK ENERGY MARKETING
Mail Contact Contact:	JAMES CIFARATTA
Mail Contact City,St,Zip:	SYRACUSE, NY 13204
Mail Phone:	(315) 460-3379

Tank Id:	004
CAS Number:	75718
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	12/70
Tank Closed:	00/00
Capacity (Gal):	1000
Chemical:	Methane, dichlorodifluoro-
Tank Location:	Indoors, Belowground
Tank Type:	Steel/carbon steel
Total Tanks:	1
Tank Secret:	False
Tank Secondary Containment:	00
Tank Error Status:	No Missing Data
Date Entered:	03/16/1992
Certified Date:	06/18/2001
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None,Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Unknown
Pipe Internal:	None
Pipe External:	01
Pipe Flag:	01
Leak Detection:	01
Overfill Protection:	04
Haz Percent:	99
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	04/01/93
Is It There:	False
Delinquent:	False
Date Expired:	07/18/95
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U003077914**

Pre-Printed Renewal App Last Printed: 03/30/2001

Tank Id:	001
CAS Number:	7664939
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	06/72
Tank Closed:	Not reported
Capacity (Gal):	1500
Chemical:	Sulfuric acid
Tank Location:	Indoors, Belowground
Tank Type:	Steel/carbon steel
Total Tanks:	1
Tank Secret:	False
Tank Secondary Containment:	01
Tank Error Status:	No Missing Data
Date Entered:	07/18/1989
Certified Date:	06/18/2001
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None,Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	01
Pipe Flag:	01
Leak Detection:	00
Overfill Protection:	04
Haz Percent:	93
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	04/01/93
Is It There:	False
Delinquent:	False
Date Expired:	07/18/95
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True
Pre-Printed Renewal App Last Printed:	03/30/2001

Tank Id:	003
CAS Number:	60004
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	02/91
Tank Closed:	00/00
Capacity (Gal):	1000
Chemical:	Ethylenediamine tetraacetic acid (EDTA)
Tank Location:	Indoors, Belowground
Tank Type:	Fiberglass reinforced plastic [FRP]
Total Tanks:	1

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U003077914**

Tank Secret:	False
Tank Secondary Containment:	01
Tank Error Status:	No Missing Data
Date Entered:	04/03/1991
Certified Date:	06/18/2001
Substance:	More than one Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None,None
Pipe Location:	Aboveground
Pipe Type:	Wrapped Steel
Pipe Internal:	None
Pipe External:	00
Pipe Flag:	00
Leak Detection:	00
Overfill Protection:	04
Haz Percent:	30
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	04/01/93
Is It There:	False
Delinquent:	False
Date Expired:	07/18/95
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True
Pre-Printed Renewal App Last Printed:	03/30/2001

Tank Id:	002
CAS Number:	60004
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	02/91
Tank Closed:	00/00
Capacity (Gal):	1000
Chemical:	Ethylenediamine tetraacetic acid (EDTA)
Tank Location:	Indoors, Belowground
Tank Type:	Fiberglass reinforced plastic [FRP]
Total Tanks:	1
Tank Secret:	False
Tank Secondary Containment:	01
Tank Error Status:	No Missing Data
Date Entered:	04/03/1991
Certified Date:	06/18/2001
Substance:	More than one Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None,None
Pipe Location:	Aboveground
Pipe Type:	Wrapped Steel
Pipe Internal:	None
Pipe External:	00
Pipe Flag:	00
Leak Detection:	00

SYRACUSE UNIVERSITY STEAM STATION (Continued) **U003077914**

Overfill Protection:	04
Haz Percent:	30
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	04/01/93
Is It There:	False
Delinquent:	False
Date Expired:	07/18/95
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True
Pre-Printed Renewal App Last Printed:	03/30/2001

B17 **SU CHILLED WATER PLANT** **NY CBS S102166574**
SE **500 E. TAYLOR STREET** **NY AST N/A**
< 1/8 **SYRACUSE, NY 13202** **NY Spills**
0.012 mi. **NY MANIFEST**
61 ft. **Site 14 of 16 in cluster B**

Relative: **Higher**
Actual: **406 ft.**

CBS:

Name:	SYRACUSE UNIVERSITY STEAM STATION
Address:	500 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY 13202
CBS Number:	7-000152
Program Type:	CBS
Facility Status:	Unregulated/Closed
Expiration Date:	Not reported
Dec Region:	7
UTMX:	406899.41504
UTMY:	4765790.33863

Name:	SU CHILLED WATER PLANT
Address:	500 E. TAYLOR STREET
City,State,Zip:	SYRACUSE, NY 13202
CBS Number:	7-000281
Program Type:	CBS
Facility Status:	Unregulated/Closed
Expiration Date:	Not reported
Dec Region:	7
UTMX:	406826.97609
UTMY:	4765824.13209

AST:

Name:	SYRACUSE UNIVERSITY STEAM STATION
Address:	500 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY 13202
Region:	STATE
DEC Region:	7
Site Status:	Unregulated/Closed
Facility Id:	7-000152
Program Type:	CBS
UTM X:	406899.41504
UTM Y:	4765790.33863

SU CHILLED WATER PLANT (Continued) **S102166574**

Expiration Date: N/A
Site Type: School

Tank Info:

Tank Number: 001
Tank Id: 187570
Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 06/01/1972
Capacity Gallons: 1500
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 06/16/2011
Register: True
Modified By: MJGRIFFI
Last Modified: 05/09/2022
Material Name: Not reported

Tank Number: 002
Tank Id: 195960
Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type: Plastic
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 02/01/2003
Capacity Gallons: 200
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 10/30/2009
Register: True
Modified By: MJGRIFFI
Last Modified: 05/09/2022
Material Name: Not reported

Tank Number: 002-A
Tank Id: 195961
Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type: Fiberglass Reinforced Plastic
Tank Status: Tank Converted to Non-Regulated Use
Pipe Model: Not reported
Install Date: 02/01/1991
Capacity Gallons: 1000
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: MJGRIFFI

SU CHILLED WATER PLANT (Continued) **S102166574**

Last Modified:	05/09/2022
Material Name:	Not reported

Tank Number:	003
Tank Id:	195962
Tank Location:	Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type:	Plastic
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	02/01/2004
Capacity Gallons:	200
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	10/30/2009
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

Tank Number:	003-A
Tank Id:	195963
Tank Location:	Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type:	Fiberglass Reinforced Plastic
Tank Status:	Tank Converted to Non-Regulated Use
Pipe Model:	Not reported
Install Date:	02/01/1991
Capacity Gallons:	1000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

Tank Number:	004
Tank Id:	190059
Tank Location:	Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Tank Converted to Non-Regulated Use
Pipe Model:	Not reported
Install Date:	12/01/1970
Capacity Gallons:	1000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MJGRIFFI

SU CHILLED WATER PLANT (Continued) **S102166574**

Last Modified: 05/09/2022
Material Name: Not reported

SPILLS:
Name: SYRACUSE UNIVERSITY
Address: 500 E TAYLOR ST
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 1902943 / 2020-03-27
Facility ID: 1902943
Facility Type: ER
DER Facility ID: 541078
Site ID: 590889
DEC Region: 7
Spill Cause: Equipment Failure
Spill Class: B4
SWIS: 3415
Spill Date: 2019-06-21
Investigator: CFNORRIS
Referred To: Not reported
Reported to Dept: 2019-06-21
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2019-06-21
Spill Record Last Update: 2020-03-27
Spiller Name: Not reported
Spiller Company: MCGINNIS NELSON CONTRACTOR
Spiller Address: Not reported
Spiller Company: 999
Contact Name: CHAD AMES
Latitude: Not reported
Longitude: Not reported
DEC Memo: Spill to stone below sidewalk during replacement of sidewalk pavers. Incident report to be sent over soon. 1/21/2019 I spoke to Chad Ames, SU Health and Safety. He will be sending the incident report and disposal information, hopefully today. REPORT RECEIVED
Remarks: loss to crushed stone, c/u in progress

All Materials:
Site ID: 590889
Operable Unit ID: 1338515
Operable Unit: 01
Material ID: 2348010
Material Code: 0010
Material Name: hydraulic oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 2.00
Units: G

SU CHILLED WATER PLANT (Continued) **S102166574**

Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	SU STEAM STATION
Address:	500 E TAYLOR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9008107 / 1990-10-24
Facility ID:	9008107
Facility Type:	ER
DER Facility ID:	280417
Site ID:	161896
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	Not reported
SWIS:	3400
Spill Date:	1990-10-24
Investigator:	DJLASALL
Referred To:	Not reported
Reported to Dept:	1990-10-24
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	1990-10-24
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	SU STEAM STATION
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0389813
Longitude:	-76.1429976
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was DL
Remarks:	PLANT PERSONNEL USED PADS TO CLEAN UP AND DISPOSED OF SAME.

All Materials:

Site ID:	161896
Operable Unit ID:	945310
Operable Unit:	01
Material ID:	559262
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	2.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

SU CHILLED WATER PLANT (Continued) **S102166574**

NY MANIFEST:

EPA ID:	NYD982271918
Country:	USA
Name:	Syracuse University Steam Station
Address:	500 E TAYLOR ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13244
Zip 4:	Not reported
Location Address 1:	500 EAST TAYLOR STREET
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13244
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Syracuse University Steam Station
Mailing Contact:	Brian Fitzpatrick
Mailing Address 1:	108 COLLEGE PLACE
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13244
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154233328

Manifest Data:

Document ID:	ILA7829484
Manifest Status:	Not reported
Trans1 State ID:	UPW018074
Year:	1999
Trans2 State ID:	UPW012400
Generator Ship Date:	07/28/1999
Trans1 Recv Date:	07/28/1999
Trans2 Recv Date:	07/30/1999
TSD Site Recv Date:	08/04/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	MAD039322250
Trans2 EPA ID:	OHD009865825
TSDF ID 1:	ILD000608471
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	The Following Spent Nonhalogenated Solvents: Xylene, Acetone, Ethyl Acetate, Ethyl Benzene, Ethyl Ether, Methyl Isobutyl Ketone, N-Butyl

SU CHILLED WATER PLANT (Continued) **S102166574**

Alcohol, Cyclohexanone, And Methanol; All Spent Solvent Mixtures/Blends Containing, Before Use, Only The Above Spent Nonhalogenated Solvents; And All Spent Solvent Mixtures/Blends Containing, Before Use, One Or More Of The Above Nonhalogenated Solvents, And A Total Of Ten Percent Or More (By Volume) Of One Or More Of Those Solvents Listed In F001, F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.

Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00440
Units: Pounds
Number of Containers: 001
Container Type: Metal drums, barrels, kegs
Handling Method: Burn
Specific Gravity: 01.00

Document ID: NYC3311436
Manifest Status: Not reported
Trans1 State ID: NYAM6504
Year: 1994
Trans2 State ID: Not reported
Generator Ship Date: 10/25/1994
Trans1 Recv Date: 10/25/1994
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/26/1994
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982271918
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID 1: NYD982743312
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: Ignitable Waste
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00021
Units: Gallons (liquids only)
Number of Containers: 002

SU CHILLED WATER PLANT (Continued) **S102166574**

Container Type: Metal drums, barrels, kegs
Handling Method: Recycle
Specific Gravity: 01.00

Document ID: NYC2998721
Manifest Status: Not reported
Trans1 State ID: NYLJ5601
Year: 1994
Trans2 State ID: Not reported
Generator Ship Date: 02/14/1994
Trans1 Recv Date: 02/14/1994
Trans2 Recv Date: Not reported
TSD Site Recv Date: 02/15/1994
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982271918
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID 1: NYD982743312
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: Ignitable Waste
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00017
Units: Gallons (liquids only)
Number of Containers: 001
Container Type: Metal drums, barrels, kegs
Handling Method: Recycle
Specific Gravity: 01.00

Document ID: NYC4837792
Manifest Status: Not reported
Trans1 State ID: NYMU2534
Year: 1997
Trans2 State ID: Not reported
Generator Ship Date: 10/07/1997
Trans1 Recv Date: 10/07/1997
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/08/1997
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982271918

SU CHILLED WATER PLANT (Continued) **S102166574**

Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00015
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYC4445504
Manifest Status:	Not reported
Trans1 State ID:	NYNF6576
Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	01/22/1997
Trans1 Recv Date:	01/22/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/23/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported

SU CHILLED WATER PLANT (Continued) **S102166574**

Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00015
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Document ID:	NYC1872843
Manifest Status:	Not reported
Trans1 State ID:	NYDN5385
Year:	1992
Trans2 State ID:	Not reported
Generator Ship Date:	10/09/1992
Trans1 Recv Date:	10/09/1992
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/09/1992
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD000824581
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00086
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD080631369

SU CHILLED WATER PLANT (Continued) **S102166574**

Year:	2018
Trans2 State ID:	NJD054126164
Generator Ship Date:	10/06/2011
Trans1 Recv Date:	10/06/2011
Trans2 Recv Date:	10/11/2011
TSD Site Recv Date:	10/12/2011
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD980536593
TSDF ID 2:	Not reported
Manifest Tracking Number:	000570816VES
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Mercury
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	17
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD080631369
Year:	2018
Trans2 State ID:	NJD054126164
Generator Ship Date:	10/06/2011
Trans1 Recv Date:	10/06/2011
Trans2 Recv Date:	10/11/2011
TSD Site Recv Date:	10/12/2011
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	Not reported

SU CHILLED WATER PLANT (Continued) **S102166574**

Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD980536593
TSDF ID 2:	Not reported
Manifest Tracking Number:	000570816VES
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Lead
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	124
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1

Document ID:	NYA5856579
Manifest Status:	K - Completed after the designated time
Trans1 State ID:	AM8365
Year:	1989
Trans2 State ID:	Not reported
Generator Ship Date:	890105
Trans1 Recv Date:	900105
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	900105
Part A Recv Date:	900111
Part B Recv Date:	900119
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported

SU CHILLED WATER PLANT (Continued) **S102166574**

Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	The Following Spent Halogenated Solvents Used In Degreasing: Tetrachloroethylene, Trichlorethylene, Methylene Chloride, 1,1,1-Trichloroethane, Carbon Tetrachloride And Chlorinated Fluorocarbons; All Spent Solvent Mixtures/Blends Used In Degreasing Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Halogenated Solvents Or Those Solvents Listed In F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00605
Units:	Gallons (liquids only)
Number of Containers:	011
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	100
Document ID:	ILA8497054
Manifest Status:	Not reported
Trans1 State ID:	UPW018074
Year:	2000
Trans2 State ID:	UPW012400
Generator Ship Date:	01/20/2000
Trans1 Recv Date:	01/20/2000
Trans2 Recv Date:	01/24/2000
TSD Site Recv Date:	02/01/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982271918
Trans1 EPA ID:	MAD039322250
Trans2 EPA ID:	OHD009865825
TSDF ID 1:	ILD000608471
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	The Following Spent Nonhalogenated Solvents: Xylene, Acetone, Ethyl Acetate, Ethyl Benzene, Ethyl Ether, Methyl Isobutyl Ketone, N-Butyl Alcohol, Cyclohexanone, And Methanol; All Spent Solvent Mixtures/Blends Containing, Before Use, Only The Above Spent

SU CHILLED WATER PLANT (Continued) **S102166574**

Nonhalogenated Solvents; And All Spent Solvent Mixtures/Blends Containing, Before Use, One Or More Of The Above Nonhalogenated Solvents, And A Total Of Ten Percent Or More (By Volume) Of One Or More Of Those Solvents Listed In F001, F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.

Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00040
Units: Gallons (liquids only)
Number of Containers: 001
Container Type: Metal drums, barrels, kegs
Handling Method: Burn
Specific Gravity: 01.00

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD080631369
Year: 2018
Trans2 State ID: NYD980769947
Generator Ship Date: 10/03/2013
Trans1 Recv Date: 10/03/2013
Trans2 Recv Date: 10/08/2013
TSD Site Recv Date: 10/09/2013
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982271918
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: OHD093945293
TSDF ID 2: Not reported
Manifest Tracking Number: 000609559VES
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H061
Waste Code a: Lead
Waste Code b: Not reported
Waste Code c: Not reported
Waste Code e: Not reported
Waste Code f: Not reported
Waste Code g: Not reported
Waste Code 1: Not reported
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported

SU CHILLED WATER PLANT (Continued) **S102166574**

Waste Code 6:	Not reported
Quantity:	28
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1

Click this hyperlink while viewing on your computer to access
85 additional NY MANIFEST: record(s) in the EDR Site Report.

B18
ESE
< 1/8
0.026 mi.
136 ft.

PROJECT ORANGE
OLD S.U. STEAM PLANT
SYRACUSE, NY

Site 15 of 16 in cluster B

NY Spills **S102165331**
N/A

Relative:
Higher

Actual:
406 ft.

SPILLS:

Name:	PROJECT ORANGE
Address:	OLD S.U. STEAM PLANT
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9207607 / 1992-09-30
Facility ID:	9207607
Facility Type:	ER
DER Facility ID:	214230
Site ID:	262415
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	E6
SWIS:	3415
Spill Date:	1992-09-29
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1992-09-30
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	1992-09-30
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	PROJECT ORANGE
Spiller Address:	1100 TOWNCOUNTRY RD
Spiller Company:	001
Contact Name:	Not reported
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM 09/30/92: NO RESPONSE WARRENTED , UPSTATE ASBESTOS IS CLEAN UP CONTRACTOR.
Remarks:	TRACY JONES 315474 8230 CALLED STEAM PIPE WATER MAIN RUPTURE BROKE

PROJECT ORANGE (Continued) **S102165331**

PIPE INSTALLTION MATERIAL DISSOLVED INTO WATER , WATER PUMPED INTO SEWERS

All Materials:

Site ID:	262415
Operable Unit ID:	974429
Operable Unit:	01
Material ID:	408237
Material Code:	0026A
Material Name:	asbestos
Case No.:	01332214
Material FA:	Hazardous Material
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Site ID:	262415
Operable Unit ID:	974429
Operable Unit:	01
Material ID:	408236
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

B19 **MC BRIDE SUB** **RCRA NonGen / NLR 1000164721**
SE **S MCBRIDE** **NY MANIFEST NYD980782775**
< 1/8 **SYRACUSE, NY 13202**
0.045 mi.
237 ft. **Site 16 of 16 in cluster B**

Relative:
Higher

Actual:
409 ft.

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	Mc Bride Sub
Handler Address:	S Mcbride
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYD980782775
Contact Name:	Not reported
Contact Address:	ERIE BLVD W
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported

MC BRIDE SUB (Continued) **1000164721**

Active Site Indicator:		Not reported
State District Owner:		Ny
State District:		NYSDEC R7
Mailing Address:		ERIE BLVD W
Mailing City,State,Zip:		SYRACUSE, NY 13202
Owner Name:	Ownername	
Owner Type:		Private
Operator Name:	Ownername	
Operator Type:		Private
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
202 GPRA Corrective Action Baseline:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No
Addressed Significant Non-Complier Universe:		No
Significant Non-Complier With a Compliance Schedule Universe:		No
Financial Assurance Required:		Not reported
Handler Date of Last Change:		20150414
Recognized Trader-Importer:		No
Recognized Trader-Exporter:		No
Importer of Spent Lead Acid Batteries:		No
Exporter of Spent Lead Acid Batteries:		No
Recycler Activity Without Storage:		No
Manifest Broker:		No
Sub-Part P Indicator:		No

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	X002
Waste Description:	Not Defined

MC BRIDE SUB (Continued) **1000164721**

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: OWNERNAME	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name: OWNERNAME	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: OWNERNAME	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	19990708
Handler Name: MC BRIDE SUB	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20060101
Handler Name: MC BRIDE SUB	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No

MC BRIDE SUB (Continued) **1000164721**

Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20070101
Handler Name: MC BRIDE SUB	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	19841120
Handler Name: MC BRIDE SUB	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Codes:	No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

NY MANIFEST:

EPA ID:	NYD980782775
Country:	USA
Name:	Niagara Mohawk Power Corporation
Address:	S MCBRIDE
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	MC BRIDE SUBSTATION
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY

MC BRIDE SUB (Continued) **1000164721**

Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: Niagara Mohawk Power Corporation
Mailing Contact: Niagara Mohawk Power Corporation
Mailing Address 1: 300 ERIE BLVD WEST
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154282351

Manifest Data:
Document ID: NYA3713005
Manifest Status: C - Completed copy
Trans1 State ID: 35218GN
Year: 1986
Trans2 State ID: 7A-010
Generator Ship Date: 860617
Trans1 Recv Date: 860617
Trans2 Recv Date: Not reported
TSD Site Recv Date: 860617
Part A Recv Date: 860625
Part B Recv Date: 860625
Generator EPA ID: NYD980782775
Trans1 EPA ID: NYD980761191
Trans2 EPA ID: Not reported
TSDF ID 1: NYD980647952
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: B003
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 02400
Units: Gallons (liquids only)
Number of Containers: 001
Container Type: Cargo tanks (tank trucks)
Handling Method: Recycle
Specific Gravity: 100

MC BRIDE SUB (Continued) **1000164721**

Document ID:	NYB1741680
Manifest Status:	Not reported
Trans1 State ID:	CR6700(NY
Year:	1990
Trans2 State ID:	Not reported
Generator Ship Date:	08/28/1990
Trans1 Recv Date:	08/28/1990
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/28/1990
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980782775
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD980647952
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B002
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00538
Units:	Kilograms
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	00.89

Document ID:	NYB1741770
Manifest Status:	Not reported
Trans1 State ID:	980C50OH
Year:	1990
Trans2 State ID:	Not reported
Generator Ship Date:	12/04/1990
Trans1 Recv Date:	12/04/1990
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/05/1990
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980782775
Trans1 EPA ID:	OHD981954571
Trans2 EPA ID:	Not reported
TSDF ID 1:	OHD981100969
TSDF ID 2:	Not reported

MC BRIDE SUB (Continued) **1000164721**

Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B002
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	05381
Units:	Kilograms
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Treat
Specific Gravity:	00.89

C20 **CITY OWNED APARTMENT COMPLEX** **NY Spills** **S131919859**
WSW **301-311 EAST TAYLOR ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.054 mi.
285 ft. **Site 1 of 9 in cluster C**

Relative: **Lower**
Actual: **399 ft.**

SPILLS:

Name:	CITY OWNED APARTMENT COMPLEX
Address:	301-311 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2400040 / Not Reported
Facility ID:	2400040
Facility Type:	ER
DER Facility ID:	609512
Site ID:	664372
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	Not reported
SWIS:	3415
Spill Date:	2024-04-02
Investigator:	CBKERLIN
Referred To:	Not reported
Reported to Dept:	2024-04-02
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False

CITY OWNED APARTMENT COMPLEX (Continued) **S131919859**

Remediation Phase:	1
Date Entered In Computer:	2024-04-02
Spill Record Last Update:	2024-04-02
Spiller Name:	MATT WALKER
Spiller Company:	UNK
Spiller Address:	301-311 EAST TAYLOR ST
Spiller Company:	999
Contact Name:	MATT WALKER
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	4/2/24: Phase II test results came back with BTEX hits in soil and water, site used to be a gas station. Part of I-81 redevelopment project. (CBK)
Remarks:	phase 2 results from 3/5/24 soil and ground water affected. clean up pending. location is an old gas stations from the 1950s

All Materials:

Site ID:	664372
Operable Unit ID:	1411191
Operable Unit:	01
Material ID:	2428949
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Soil, Groundwater
Oxygenate:	Not reported

D21 **ERP SITE** **NY Spills** **S131511286**
SSE **1226 MCBRIDE ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.056 mi.
298 ft. **Site 1 of 4 in cluster D**

Relative:
Higher

Actual:
408 ft.

SPILLS:

Name:	ERP SITE
Address:	1226 MCBRIDE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2308014 / Not Reported
Facility ID:	2308014
Facility Type:	ER
DER Facility ID:	606442
Site ID:	661110
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	D4
SWIS:	3415
Spill Date:	2023-12-28
Investigator:	ACLOFARO
Referred To:	Not reported
Reported to Dept:	2024-01-04
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial

ERP SITE (Continued) **S131511286**

Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	1
Date Entered In Computer:	2024-01-04
Spill Record Last Update:	2024-01-18
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	WAYNE RANDLE
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	01/04/23: Oil accumulating in a groundwater monitoring well. CNS to monitor weekly to see if this is a trend or if oil was intentionally dumped in well. 8ft of product in well when sampled on 12/28 during 15-month sampling and 2ft when sampled yesterday. Well is 2 PVC. (CBK)
Remarks:	DEC REP Andrew Loforow lead. Sampling groundwater and found free product in well. Approx 6 courts of oil removed.

All Materials:

Site ID:	661110
Operable Unit ID:	1407916
Operable Unit:	01
Material ID:	2425374
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Groundwater
Oxygenate:	Not reported

D22 **MCKINNEY PROPERTY** **NY ENG CONTROLS** **S108984459**
SSE **1226 SOUTH MCBRIDE STREET** **NY INST CONTROL** **N/A**
< 1/8 **SYRACUSE, NY 13202** **NY ERP**
0.056 mi. **NY Spills**
298 ft. **Site 2 of 4 in cluster D**

Relative: Higher

Actual: 408 ft.

ENG CONTROLS:

Name:	MCKINNEY PROPERTY
Address:	1226 SOUTH MCBRIDE STREET
City,State,Zip:	SYRACUSE, NY 13202-
Site Code:	57334
HW Code:	E734086
Control Code:	15
Control Type:	ENG
Date Record Added:	12/04/2015
Date Rec Updated:	10/27/2022
Updated By:	GWPRISCO

MCKINNEY PROPERTY (Continued) **S108984459**

Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically

MCKINNEY PROPERTY (Continued) **S108984459**

polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related

MCKINNEY PROPERTY (Continued) **S108984459**

contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	False
Record Add:	2004-01-22 11:57:00
Record Upd:	2012-10-04 14:39:00
Updated By:	ldennist
Own Op:	1
Sub Type:	C01
Owner Name:	William Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	C01
Owner Name:	Melissa Liquori
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	E734086
Waste Type:	BENZENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	CHROMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BENZO[K]FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	Petroleum Products

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	TRICHLOROETHENE (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BENZO(B)FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	Chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	ACENAPHTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BARIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	DIBENZ[A,H]ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	LEAD
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	indeno(1,2,3-cd)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	ZINC
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	NAPHTHALENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	XYLENE (MIXED)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	ARSENIC
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	MERCURY
Waste Quantity:	UNKNOWN

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Code:	Not reported
HW Code:	E734086
Waste Type:	POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BENZ(A)ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BENZO(A)PYRENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	COPPER
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	CADMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	1,2-dichlorobenzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	C302977
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2015-12-21 13:49:00
Record Updated:	2015-12-21 13:49:00
Updated By:	JPCOOK
Crossref ID:	L/P 05344 / 0902
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2015-11-02 10:43:00
Record Updated:	2015-11-02 10:43:00
Updated By:	JPCOOK

INST CONTROL:

Name:	MCKINNEY PROPERTY
Address:	1226 SOUTH MCBRIDE STREET
City,State,Zip:	SYRACUSE, NY 13202-
Site Code:	57334
Control Name:	Ground Water Use Restriction
HW Code:	E734086
Control Code:	08
Control Type:	INST
Dt record added:	12/04/2015
Dt rec updated:	10/27/2022
Updated By:	GWPRISCO
Site Code:	57334
Site Description:	"Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is

MCKINNEY PROPERTY (Continued) **S108984459**

generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values

MCKINNEY PROPERTY (Continued) **S108984459**

(SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is

MCKINNEY PROPERTY (Continued) **S108984459**

similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: False
Record Add: 2004-01-22 11:57:00
Record Upd: 2012-10-04 14:39:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: William Simmons
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Melissa Liquori
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: E734086
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported

MCKINNEY PROPERTY (Continued) **S108984459**

HW Code:	E734086
Waste Type:	BENZO(B)FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	Chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	ACENAPHTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BARIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	DIBENZ[A,H]ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	LEAD
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	indeno(1,2,3-cd)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	ZINC
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	NAPHTHALENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	XYLENE (MIXED)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	ARSENIC
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	MERCURY
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Control Name: IC/EC Plan
HW Code: E734086
Control Code: 34
Control Type: INST
Dt record added: 12/04/2015
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57334
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA),

MCKINNEY PROPERTY (Continued) **S108984459**

including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated

MCKINNEY PROPERTY (Continued) **S108984459**

concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and

MCKINNEY PROPERTY (Continued) **S108984459**

occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: False
Record Add: 2004-01-22 11:57:00
Record Upd: 2012-10-04 14:39:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: William Simmons
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Melissa Liquori
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: E734086
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Chrysene
Waste Quantity: UNKNOWN

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Code: Not reported
HW Code: E734086
Waste Type: ACENAPHTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ZINC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: XYLENE (MIXED)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported

MCKINNEY PROPERTY (Continued) **S108984459**

HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Control Name: Landuse Restriction
HW Code: E734086
Control Code: 25
Control Type: INST
Dt record added: 12/04/2015
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57334
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is

MCKINNEY PROPERTY (Continued) **S108984459**

bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium;

MCKINNEY PROPERTY (Continued) **S108984459**

copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False

MCKINNEY PROPERTY (Continued) **S108984459**

Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: False
Record Add: 2004-01-22 11:57:00
Record Upd: 2012-10-04 14:39:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: William Simmons
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Melissa Liquori
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: E734086
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ACENAPHTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BARIUM

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ZINC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: XYLENE (MIXED)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Control Name: Soil Management Plan
HW Code: E734086
Control Code: 14
Control Type: INST
Dt record added: 12/04/2015
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57334
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal

MCKINNEY PROPERTY (Continued) **S108984459**

working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial

MCKINNEY PROPERTY (Continued) **S108984459**

use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: False
Record Add: 2004-01-22 11:57:00
Record Upd: 2012-10-04 14:39:00
Updated By: ldennist

MCKINNEY PROPERTY (Continued) **S108984459**

Own Op: 1
Sub Type: C01
Owner Name: William Simmons
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Melissa Liquori
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: E734086
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ACENAPHTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ZINC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: XYLENE (MIXED)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23

MCKINNEY PROPERTY (Continued) **S108984459**

Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Control Name: Monitoring Plan
HW Code: E734086
Control Code: 31
Control Type: INST
Dt record added: 12/04/2015
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57334
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet

MCKINNEY PROPERTY (Continued) **S108984459**

of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use

MCKINNEY PROPERTY (Continued) **S108984459**

SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: False
Record Add: 2004-01-22 11:57:00
Record Upd: 2012-10-04 14:39:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: William Simmons
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202

MCKINNEY PROPERTY (Continued) **S108984459**

Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Melissa Liquori
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: E734086
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ACENAPHTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported

MCKINNEY PROPERTY (Continued) **S108984459**

HW Code: E734086
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ZINC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: XYLENE (MIXED)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier

MCKINNEY PROPERTY (Continued) **S108984459**

Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Control Name: Site Management Plan
HW Code: E734086
Control Code: 32
Control Type: INST
Dt record added: 12/04/2015
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57334
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the

MCKINNEY PROPERTY (Continued) **S108984459**

lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this

MCKINNEY PROPERTY (Continued) **S108984459**

well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: False
Record Add: 2004-01-22 11:57:00
Record Upd: 2012-10-04 14:39:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: William Simmons
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Melissa Liquori
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported

MCKINNEY PROPERTY (Continued) **S108984459**

Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: E734086
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ACENAPHTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ZINC
Waste Quantity: UNKNOWN

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Code: Not reported
HW Code: E734086
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: XYLENE (MIXED)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-

MCKINNEY PROPERTY (Continued) **S108984459**

Site Code: 57334
Control Name: Environmental Easement
HW Code: E734086
Control Code: J
Control Type: INST
Dt record added: 12/04/2015
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57334
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."

MCKINNEY PROPERTY (Continued) **S108984459**

Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to

MCKINNEY PROPERTY (Continued) **S108984459**

groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including 1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: False
Record Add: 2004-01-22 11:57:00
Record Upd: 2012-10-04 14:39:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: William Simmons
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Melissa Liquori
Owner Company: Syracuse Housing Authority
Owner Address: 516 Burt Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: E734086
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Type:	CHROMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BENZO[K]FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	Petroleum Products
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	TRICHLOROETHENE (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BENZO(B)FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	Chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	ACENAPHTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	BARIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	METHYL-TERT-BUTYL ETHER (MTBE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	DIBENZ[A,H]ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	LEAD
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	indeno(1,2,3-cd)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	ZINC
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	NAPHTHALENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	E734086
Waste Type:	XYLENE (MIXED)

MCKINNEY PROPERTY (Continued) **S108984459**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: MERCURY
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: E734086
Waste Type: 1,2-dichlorobenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C302977
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-12-21 13:49:00
Record Updated: 2015-12-21 13:49:00
Updated By: JPCOOK
Crossref ID: L/P 05344 / 0902
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-02 10:43:00
Record Updated: 2015-11-02 10:43:00
Updated By: JPCOOK

ERP:
Name: MCKINNEY PROPERTY
Address: 1226 SOUTH MCBRIDE STREET
City,State,Zip: SYRACUSE, NY 13202-
Site Code: 57334
Program: ERP
HW Code: E734086
Site Class: C
Class N: C
SWIS: 3415

MCKINNEY PROPERTY (Continued) **S108984459**

Region: 7
Town: Syracuse (c)
Acres: 0.600
Record Added: 01/22/2004
Record Updated: 02/13/2024
Updated By: GWPRISCO
Site Description: "Location: The McKinney Property site is an approximately 0.60-acre site located at 1226 McBride Street, on the northwest corner of South McBride Street and Burt Street, in an urban area of the City of Syracuse. Site Features: The site is developed as a gravel parking lot with a vegetated strip extending along the northern, eastern and southern site perimeter. There are no buildings on the site. It is generally flat, with a gentle slope from northwest to southeast. There is a concrete retaining wall along the north boundary of the site, which supports an elevated rail line. Current Zoning and Land Use: The majority of the site is a parking lot. It is zoned for commercial use. The surrounding parcels are used for a mix of commercial, industrial, and residential purposes. Several nearby properties are owned by the Syracuse Housing Authority (SHA), including a large residential apartment building. There are also several townhouses located south of the site, across Burt Street from the site. The site is bordered to the north by an elevated railroad line. A portion of the Syracuse University steam plant facility lies beyond the rail line to the north. The site is bordered to the south by Burt Street, with residential buildings beyond. An electrical substation is located further south. To the east, the site is bordered by South McBride Street, with the elevated rail line and the rest of the Syracuse University steam plant lying beyond. To the west, the site is bordered by a commercial property owned by SHA, with vacant lots and Oakwood Avenue beyond. Beyond Oakwood Avenue are vacant lots and two small commercial properties. Past Use of the Site: The site was previously occupied by a metal working company and a scrap metal storage/processing business. The metal working/processing operations have led to contamination of the site by metals and oils. Equipment associated with these operations also contributed to contamination, including underground storage tanks, capacitors containing dielectric fluids, an oil/water separator and hydraulic machinery. Site Geology and Hydrogeology: Unconsolidated deposits in the area have been mapped as lacustrine silt and clay. Soil encountered during the investigation consisted of several feet of fill material, underlain by the lacustrine unit, which consisted of silt and clay with lesser amounts of fine sand. The fill was generally approximately 2 feet thick, but ranged up to 9 feet thick. The fill unit consisted of fill or reworked native deposits, mixed with gravel, concrete, metal, wood and other anthropogenic materials. The lacustrine unit showed interlaminations of silt, clay and sand, showing the annual cycle of deposition (varves). It is expected the lacustrine unit is underlain by till; however, neither the till nor bedrock were encountered in any boring advanced at the site. Borings were installed to a maximum depth of 22 feet below grade. Depth to groundwater varied seasonally and ranged from 2.4 feet below grade to 9.6 feet below grade. The predominant direction of groundwater flow at the Site was determined to be south/southwest toward Onondaga Creek."
Env Problem: "Certain areas of contamination were excavated and disposed of off-site as interim remedial measures (IRMs). A one-foot clean soil cover system has been installed across the entire site. Contamination

MCKINNEY PROPERTY (Continued) **S108984459**

at concentrations greater than commercial use soil cleanup objectives (SCOs) remains below the cover system and is being managed under a Site Management Plan. Nature and Extent of Contamination: The primary contaminants of concern at the site are metals, including arsenic, barium, cadmium, copper, lead, and mercury; polychlorinated biphenyls (PCBs); and semi-volatile organic compounds (SVOCs), specifically polycyclic aromatic hydrocarbons (PAHs), which are a subset of SVOCs. Petroleum was also encountered in certain locations at the site, though the areas with the heaviest known petroleum contamination were excavated and disposed of off-site by the IRMs. Several volatile organic compounds (VOCs) were detected in soil vapor and were also detected above applicable standards, criteria or guidance values (SCGs) in soil and groundwater; however, to a lesser extent than the other contaminants of concern. No site-related contamination was identified off-site. Soil Contaminants, including metals, PAHs and, to a lesser extent, PCBs remain in soil below the cover system. These contaminants are primarily present in soil immediately below the cover system, at depths ranging from one foot to approximately three feet below grade. Mercury is present across the site at elevated concentrations, primarily in the two feet of soil immediately below the cover system (one foot to three feet below grade). It is present at concentrations up to 438 parts per million (ppm) compared to its soil cleanup objective (SCO) for the protection of public health for commercial use of 2.8 ppm. Similarly, other metals are present at elevated concentrations across the site, primarily in the two feet of soil immediately below the cover system. Arsenic; barium; cadmium; copper; and lead were detected at concentrations up to 218; 6,390; 139; 51,100; and 19,200 ppm, respectively, compared to their respective commercial use SCOs of 16; 400; 9.3; 270; and 1,000 ppm. PAHs are present across the site in the two feet of soil immediately below the cover system, generally at concentrations only slightly exceeding commercial use SCOs, though a couple locations had somewhat higher concentrations. Benzo(a)pyrene, a PAH, exceeded its commercial use SCO more frequently than the other PAHs, and is present at concentrations up to 7.2 ppm, compared to its commercial use SCO of 1 ppm. Concentrations of total PAHs in soils below the cover system range from not detected to 400.8 ppm. PCBs are present across the site in the two feet of soil immediately below the cover system at concentrations exceeding its commercial use SCO. PCBs are present in soils at concentrations up to 29 ppm, compared to its commercial use SCO of 1 ppm. Trichloroethene (TCE) is present in subsurface soil in one area of the site at concentrations up to 6.84 ppm, exceeding its SCO for the protection of groundwater of 0.47 ppm. Groundwater - Groundwater impacts by petroleum were previously noted in a well located at the upgradient edge (northwest corner) of the site. A layer of separate phase petroleum several feet thick was identified in this well. The petroleum contamination in the vicinity of this well was excavated as part of an IRM conducted in 2014. TCE was previously detected in groundwater at concentrations exceeding its groundwater standard of 5 ug/L. The most heavily contaminated soil in this vicinity was excavated and disposed of off-site as part of an IRM conducted in 2014. Groundwater monitoring shows TCE concentrations in groundwater have been reduced. Groundwater results for the rest of the site indicated relatively minor impacts to groundwater quality. The impacts noted were generally only slightly above groundwater standards and/or were not extending off-site. Soil Vapor - Several VOCs were detected in soil vapor including

MCKINNEY PROPERTY (Continued) **S108984459**

1,1,1-trichloroethane (which was detected at 5.66 micrograms per cubic meter [ug/m3]); cis-1,2-dichloroethene (which was detected at 0.443 ug/m3); tetrachloroethene (which was detected at 4.96 ug/m3); and trichloroethene (which was detected at 1.37 ug/m3)."

Health Problem: "People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by site-related contamination. Contact with contaminated soil remaining at the site is unlikely unless people dig below the soil cover system and demarcation layer that exists across the entire site. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Because there are no on-site buildings, inhalation of site contaminants in indoor air due to soil vapor intrusion does not represent a concern for the site in its current condition. However, the potential exists for the inhalation of site contaminants due to soil vapor intrusion for any future on-site building development and occupancy. Furthermore, environmental data available for an off-site property indicates that soil vapor intrusion is not a concern. "

SPILLS:

Name:	PRIVATE RESIDENCE
Address:	1226 SOUTH MCBRIDE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0402274 / 2004-06-04
Facility ID:	0402274
Facility Type:	ER
DER Facility ID:	168092
Site ID:	202067
DEC Region:	7
Spill Cause:	Other
Spill Class:	E6
SWIS:	3415
Spill Date:	2004-05-31
Investigator:	CXROSSI
Referred To:	Not reported
Reported to Dept:	2004-06-01
CID:	444
Water Affected:	Not reported
Spill Source:	Private Dwelling
Spill Notifier:	Fire Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-06-01
Spill Record Last Update:	2004-06-04
Spiller Name:	JOE GALLAWAY
Spiller Company:	PRIVATE RESIDENCE
Spiller Address:	1226 SOUTH MCBRIDE
Spiller Company:	001
Contact Name:	JOE GALLAWAY
Latitude:	43.0387069

MCKINNEY PROPERTY (Continued) **S108984459**

Longitude:	-76.1438841
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CTR
Remarks:	A FIRE AT THIS RESIDENCE YESTERDAY, NEED DEC TO RESPOND, TO TALK ABOUT CONTAMINATION AND DEBRIS: ON SCENE RIGHT NOW: FD Called Hotline to get response on if there was a record of contamination.
Name:	FORMER SCRAP METAL FACILI
Address:	1226 SOUTH MCBRIDE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0712291 / 2009-02-10
Facility ID:	0712291
Facility Type:	ER
DER Facility ID:	168092
Site ID:	393888
DEC Region:	7
Spill Cause:	Other
Spill Class:	C3
SWIS:	3415
Spill Date:	2008-02-21
Investigator:	menash
Referred To:	Not reported
Reported to Dept:	2008-02-21
CID:	406
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2008-02-21
Spill Record Last Update:	2009-02-10
Spiller Name:	SYRACUSE HOUSING AUTHORIT
Spiller Company:	FORMER SCRAP METAL FACILI
Spiller Address:	1226 SOUTH MCBRIDE
Spiller Company:	001
Contact Name:	SYRACUSE HOUSING AUTHORIT
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Spill turned over to Enviromental Remediation(Haz Waste) ERP Site E734086. Claudia Boutot Project Manager.
Remarks:	Gauging existing monitoring wells at the site found free product in one of the wells... #MW3 northwest corner of the site. Dvirka & Bartilucci are doing the investigations and the remediation.

All Materials:

Site ID:	393888
Operable Unit ID:	1150838
Operable Unit:	01
Material ID:	2141481
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported

MCKINNEY PROPERTY (Continued) **S108984459**

Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

D23 **SYRACUSE HOUSING AUTHORITY** **RCRA-LQG 1000889954**
South **409 BURT ST** **FINDS NY0000201889**
< 1/8 **SYRACUSE, NY 13202** **ECHO**
0.069 mi. **NY MANIFEST**
366 ft. **Site 3 of 4 in cluster D**

Relative: **Lower**

Actual: **399 ft.**

RCRA Listings:

Date Form Received by Agency:		20100309
Handler Name:		Syracuse Housing Authority
Handler Address:		Burt St
Handler City,State,Zip:		SYRACUSE, NY 13202
EPA ID:		NY0000201889
Contact Name:		WILLIAM W GEHRKE
Contact Address:		Not reported
Contact City,State,Zip:		Not reported
Contact Telephone:		315-475-6181 x4318
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		02
Land Type:		Federal
Federal Waste Generator Description:		Large Quantity Generator
Non-Notifier:		Not reported
Biennial Report Cycle:		2009
Accessibility:		Not reported
Active Site Indicator:		Handler Activities
State District Owner:		Ny
State District:		NYSDEC R7
Mailing Address:		BURT ST
Mailing City,State,Zip:		SYRACUSE, NY 13202
Owner Name:	Syracuse Housing Authority	
Owner Type:		Federal
Operator Name:	Syracuse Housing Authority	
Operator Type:		Federal
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		The land is federally-owned, The site is federally-owned, The site is federally-operated
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20210917
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Biennial: List of Years
Year: 2009

Click Here for Biennial Reporting System Data:

Hazardous Waste Summary:
Waste Code: D001
Waste Description: Ignitable Waste

Waste Code: D002
Waste Description: Corrosive Waste

Waste Code: F003
Waste Description: The Following Spent Nonhalogenated Solvents: Xylene, Acetone, Ethyl Acetate, Ethyl Benzene, Ethyl Ether, Methyl Isobutyl Ketone, N-Butyl Alcohol, Cyclohexanone, And Methanol; All Spent Solvent Mixtures/Blends Containing, Before Use, Only The Above Spent Nonhalogenated Solvents; And All Spent Solvent Mixtures/Blends Containing, Before Use, One Or More Of The Above Nonhalogenated Solvents, And A Total Of Ten Percent Or More (By Volume) Of One Or More Of Those Solvents Listed In F001, F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.

Waste Code: U213
Waste Description: Furan, Tetrahydro-(I) (Or) Tetrahydrofuran (I)

Handler - Owner Operator:
Owner/Operator Indicator: Owner
Owner/Operator Name: SEYMOUR ROTH EL-ROH
Legal Status: Private
Date Became Current: Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, NY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: SEYMOUR ROTH EL-ROH	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, NY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY	
Legal Status:	Other
Date Became Current:	19400115
Date Ended Current:	Not reported
Owner/Operator Address:	516 BURT ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name: SEYMOUR ROTH EL-ROH	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, NY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY	
Legal Status:	Other
Date Became Current:	19400115
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Owner/Operator Name: SYRACUSE HOUSING AUTHORITY
Legal Status: Federal
Date Became Current: 19400204
Date Ended Current: Not reported
Owner/Operator Address: 409 BURT ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY
Legal Status: Federal
Date Became Current: 19400204
Date Ended Current: Not reported
Owner/Operator Address: 409 BURT ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20100309
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: Not reported
Recognized Trader Exporter: Not reported
Spent Lead Acid Battery Importer: Not reported
Spent Lead Acid Battery Exporter: Not reported
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 19990708
Handler Name: SYRACUSE HOUSING AUTH
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: SYRACUSE HOUSING AUTH
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: SYRACUSE HOUSING AUTH
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19940406
Handler Name: SYRACUSE HOUSING AUTH
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20090618
Handler Name: SYRACUSE HOUSING AUTH
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 92511
NAICS Description: Administration Of Housing Programs

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

FINDS:
Registry ID: 110004313706

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
All generators and treatment, storage, and disposal (TSD) facilities who handle hazardous waste are required to report to the EPA Administrator at least once every two years. The data collected is used to create the National Biennial Resource Conservation and Recovery Act (RCRA) Hazardous Waste Report. This data is processed within the RCRA Information (RCRAInfo) database
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1000889954
Registry ID: 110004313706

DFR URL:
Name: SYRACUSE HOUSING AUTHORITY
Address: 409 BURT STREET
City,State,Zip: SYRACUSE, NY 13202

NY MANIFEST:
EPA ID: NY0000201889
Country: USA
Name: Syracuse Housing Authority
Address: 409 BURT STREET
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported
Location Address 1: 409 BURT STREET
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: Syracuse Housing Authority
Mailing Contact: David Lessun
Mailing Address 1: 409 BURT ST
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154756181

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Manifest Data:

Document ID:	NJA1848024
Manifest Status:	Not reported
Trans1 State ID:	NYLW1771
Year:	1994
Trans2 State ID:	08690
Generator Ship Date:	09/28/1994
Trans1 Recv Date:	09/28/1994
Trans2 Recv Date:	09/29/1994
TSD Site Recv Date:	09/30/1994
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000201889
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	ILD984908202
TSDF ID 1:	NJD002182897
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	The Following Spent Nonhalogenated Solvents: Xylene, Acetone, Ethyl Acetate, Ethyl Benzene, Ethyl Ether, Methyl Isobutyl Ketone, N-Butyl Alcohol, Cyclohexanone, And Methanol; All Spent Solvent Mixtures/Blends Containing, Before Use, Only The Above Spent Nonhalogenated Solvents; And All Spent Solvent Mixtures/Blends Containing, Before Use, One Or More Of The Above Nonhalogenated Solvents, And A Total Of Ten Percent Or More (By Volume) Of One Or More Of Those Solvents Listed In F001, F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00556
Units:	Pounds
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980253
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	12/23/2009

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Trans1 Recv Date:	12/23/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/05/2010
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000201889
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	000634453JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Mercury
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	300
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980253
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	12/23/2009
Trans1 Recv Date:	12/23/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/05/2010
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000201889
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Manifest Tracking Number:	000634453JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Mercury
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	200
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	07/10/2009
Trans1 Recv Date:	07/10/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/17/2009
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000201889
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	002474219FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Ignitable Waste
Waste Code b:	Furan, Tetrahydro-(I) (Or) Tetrahydrofuran (I)
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1100
Units:	Pounds
Number of Containers:	1
Container Type:	Wooden boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	07/10/2009
Trans1 Recv Date:	07/10/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/17/2009
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000201889
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	002474219FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Ignitable Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1000
Units:	Pounds
Number of Containers:	1
Container Type:	Wooden boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	07/10/2009
Trans1 Recv Date:	07/10/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/17/2009
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000201889
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	002474219FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Ignitable Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1100
Units:	Pounds
Number of Containers:	1
Container Type:	Wooden boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	07/10/2009
Trans1 Recv Date:	07/10/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/17/2009
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000201889
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	002474219FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Ignitable Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1200
Units:	Pounds
Number of Containers:	1
Container Type:	Wooden boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	NJ0000027193
Generator Ship Date:	07/10/2009
Trans1 Recv Date:	07/10/2009
Trans2 Recv Date:	07/17/2009
TSD Site Recv Date:	07/20/2009
Part A Recv Date:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1000889954**

Part B Recv Date:	Not reported
Generator EPA ID:	NY0000201889
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	002474221FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	B003
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	3
Units:	Kilograms
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1

E24 **ONONDAGA PLAZA** **NY Spills** **S102167604**
NW **LINCOLN CENTER** **N/A**
< 1/8 **SYRACUSE, NY**
0.073 mi.
388 ft. **Site 1 of 2 in cluster E**

Relative: **Lower**
Actual: **398 ft.**

SPILLS:

Name:	ONONDAGA PLAZA
Address:	LINCOLN CENTER
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9405994 / 1994-08-02
Facility ID:	9405994
Facility Type:	ER
DER Facility ID:	180512
Site ID:	218180
DEC Region:	7
Spill Cause:	Housekeeping
Spill Class:	E6
SWIS:	3415
Spill Date:	1994-08-02

ONONDAGA PLAZA (Continued) **S102167604**

Investigator:	RJBRAZEL
Referred To:	Not reported
Reported to Dept:	1994-08-02
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Citizen
Cleanup Ceased:	1994-08-02
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1994-08-02
Spill Record Last Update:	1994-08-04
Spiller Name:	Not reported
Spiller Company:	SESSLER EXCAVATION
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was RB 09/28/95: This is additional information about material spilled from the translation of the old spill file: DUST/DEBRIS CONSTRUC. Not reported
Remarks:	DEBRIS FLYING ALL OVER FROM PULLING FACADE OFF OF BUILDING.

All Materials:

Site ID:	218180
Operable Unit ID:	1000247
Operable Unit:	01
Material ID:	379037
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Air
Oxygenate:	Not reported

D25 **SYRACUSE HOUSING AUTHORITY** **PA MANIFEST** **S111771520**
SSE **BURT & MCBRIDE ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.078 mi.
412 ft. **Site 4 of 4 in cluster D**

Relative: **Higher**

Actual: **408 ft.**

PA MANIFEST:

Name:	SYRACUSE HOUSING AUTHORITY
Address:	BURT & MCBRIDE ST
City,State,Zip:	SYRACUSE, NY 13202
Year:	2009
Manifest Number:	000634453JJK
Manifest Type:	T

SYRACUSE HOUSING AUTHORITY (Continued) **S111771520**

Generator EPA ID:	NY0000201889
Generator Date:	12/23/2009
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	NULL
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D009
Container Number:	1
Container Type:	DM
Waste Quantity:	300
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

Year:	2009
Manifest Number:	000634453JJK
Manifest Type:	T
Generator EPA ID:	NY0000201889
Generator Date:	12/23/2009
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	NULL
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	2
Waste Number:	D009
Container Number:	1
Container Type:	DM
Waste Quantity:	200
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

E26
NW
< 1/8
0.079 mi.
418 ft.

NY1-1 PIONEER HOMES | **NY UST** | **U004079888**
ADAMS/RENWICK/TAYLOR/STATE | **N/A**
SYRACUSE, NY 13202

Site 2 of 2 in cluster E

Relative:
Lower

Actual:
398 ft.

UST:

Name:	NY1-1 PIONEER HOMES
Address:	ADAMS/RENWICK/TAYLOR/STATE
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-498947 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	406600.05465
UTM Y:	4766007.99600
Site Type:	Apartment Building/Office Building

Affiliation Records:

Site Id:	46336
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	EXECUTIVE DIRECTOR
Contact Name:	WILLIAM SIMMONS
Address1:	516 BURT ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 475-6181
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2011-01-14

Site Id:	46336
Affiliation Type:	Mail Contact
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	ANDREW BARSUCH
Address1:	516 BURT ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 475-6181
EMail:	ABARSUCH@SYRHOUSING.ORG
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2011-01-14

Site Id:	46336
Affiliation Type:	Facility Operator
Company Name:	NY1-1 PIONEER HOMES
Contact Type:	Not reported
Contact Name:	GREG PALMER
Address1:	Not reported

NY1-1 PIONEER HOMES (Continued) **U004079888**

Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 706-3727
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2011-01-14

Site Id:	46336
Affiliation Type:	Emergency Contact
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	ANDREW BARSUCH
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(315) 439-4788
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2011-01-14

Tank Info:

Tank Number:	003
Tank ID:	133569
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	5000
Install Date:	12/01/1984
Date Tank Closed:	04/01/1994
Registered:	True
Tank Location:	Underground
Tank Type:	Fiberglass coated steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None
I04 - Overfill - Product Level Gauge (A/G)
B04 - Tank External Protection - Fiberglass
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None

NY1-1 PIONEER HOMES (Continued) **U004079888**

A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

Tank Number:	004
Tank ID:	133570
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	10000
Install Date:	12/01/1984
Date Tank Closed:	11/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Fiberglass coated steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None
I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
B04 - Tank External Protection - Fiberglass
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

F27 **PROJECT ORANGE** **NY CBS** **1000790137**
ESE **520 E TAYLOR ST** **NY AST** **NYD987016136**
< 1/8 **SYRACUSE, NY 13202** **NY CBS AST**
0.092 mi. **NY Spills**
487 ft. **Site 1 of 5 in cluster F** **RCRA NonGen / NLR**
NY AIRS
Relative: Higher **NY MANIFEST**

Actual: 408 ft.

CBS:

Name:	PROJECT ORANGE
Address:	520 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY 13202
CBS Number:	7-000230
Program Type:	CBS
Facility Status:	Unregulated/Closed
Expiration Date:	Not reported
Dec Region:	7
UTMX:	406845.00000
UTMY:	4765829.00000

AST:

Name:	PROJECT ORANGE

PROJECT ORANGE (Continued) **1000790137**

Address:	520 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY 13202
Region:	STATE
DEC Region:	7
Site Status:	Unregulated/Closed
Facility Id:	7-000230
Program Type:	CBS
UTM X:	406845.00000
UTM Y:	4765829.00000
Expiration Date:	N/A
Site Type:	Utility (Other than Municipal)

Tank Info:

Tank Number:	T-100
Tank Id:	190104
Tank Location:	Aboveground - contact with impervious barrier... Tank bottom rests on impervious barrier, allowing visual indication of leaks.
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	04/01/1992
Capacity Gallons:	7000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	01/17/2011
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

Tank Number:	T-200
Tank Id:	190105
Tank Location:	Aboveground - contact with impervious barrier... Tank bottom rests on impervious barrier, allowing visual indication of leaks.
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	04/01/1992
Capacity Gallons:	7000
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	01/17/2011
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

CBS AST:

CBS Number:	7-000230
ICS Number:	Not reported
PBS Number:	Not reported
MOSF Number:	Not reported
SPDES Number:	Not reported

PROJECT ORANGE (Continued) **1000790137**

Facility Status:	IN SERVICE
Facility Type:	I
Telephone:	(315) 474-8230
Facility Town:	SYRACUSE (C)
Region:	STATE
Expiration Date:	04/29/2002
Total Capacity of All Active Tanks(gal):	14000
Operator:	GENERAL ELECTRIC
Emergency Contact:	JEFF GUYSKY
Emergency Phone:	(315) 474-8230
Owner Name:	PROJECT ORANGE ASSOCIATES, L.P.
Owner Address:	507 PLUM STREET
Owner City,St,Zip:	SYRACUSE, NY 13204
Owner Telephone:	(315) 460-3379
Owner Type:	Corporate/Commercial
Owner Sub Type:	Not reported
Mail Name:	NIAGARA MOHAWK ENERGY
Mail Contact Addr:	507 PLUM STREET
Mail Contact Addr2:	Not reported
Mail Contact Contact:	JAMES C. FARATTA
Mail Contact City,St,Zip:	SYRACUSE, NY 13204
Mail Phone:	(315) 460-3379

Tank Id:	T-200
CAS Number:	1310732
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	04/92
Tank Closed:	Not reported
Capacity (Gal):	7000
Chemical:	Sodium hydroxide
Tank Location:	Indoors, Aboveground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	04/28/1992
Certified Date:	02/08/2000
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	Epoxy Liner
External Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Pipe Flag:	Painted/Asphalt Coating
Leak Detection:	None
Overfill Protection:	54
Haz Percent:	50
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	76|08|36 / 43|02|59
Is Updated:	False
Renew Date:	/ /
Is It There:	False

PROJECT ORANGE (Continued) **1000790137**

Delinquent:	False
Date Expired:	04/29/94
Owner Mark:	1
Certificate Needs to be Printed:	76|08|36 / 43|02|59
Fiscal Amt for Registration Fee Correct:	76|08|36 / 43|02|59
Renewal Has Been Printed for Facility:	76|08|36 / 43|02|59
Pre-Printed Renewal App Last Printed:	76|08|36 / 43|02|59

Tank Id:	T-100
CAS Number:	7664939
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	04/92
Tank Closed:	Not reported
Capacity (Gal):	7000
Chemical:	Sulfuric acid
Tank Location:	Indoors, Aboveground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	04/28/1992
Certified Date:	02/08/2000
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	Other
External Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Pipe Flag:	Painted/Asphalt Coating
Leak Detection:	None
Overfill Protection:	54
Haz Percent:	93
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	76|08|36 / 43|02|59
Is Updated:	False
Renew Date:	/ /
Is It There:	False
Delinquent:	False
Date Expired:	04/29/94
Owner Mark:	1
Certificate Needs to be Printed:	76|08|36 / 43|02|59
Fiscal Amt for Registration Fee Correct:	76|08|36 / 43|02|59
Renewal Has Been Printed for Facility:	76|08|36 / 43|02|59
Pre-Printed Renewal App Last Printed:	76|08|36 / 43|02|59

SPILLS:

Name:	PROJECT ORANGE CO-GEN
Address:	520 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0001904 / 2002-06-03
Facility ID:	0001904

PROJECT ORANGE (Continued) **1000790137**

Facility Type:	ER
DER Facility ID:	184663
Site ID:	223336
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	3415
Spill Date:	2000-05-15
Investigator:	CXROSSI
Referred To:	Not reported
Reported to Dept:	2000-05-15
CID:	397
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	2000-05-15
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2000-05-15
Spill Record Last Update:	2002-06-03
Spiller Name:	JAMES MCCUMBER
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	029 LYMAN HALL
Spiller Company:	001
Contact Name:	CALLER
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CTR
Remarks:	caller states his company has found fuel oil on thier property. caller would like a call to give specific location of spill

All Materials:

Site ID:	223336
Operable Unit ID:	823585
Operable Unit:	01
Material ID:	550288
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	SYRACUSE UNIVERSITY STEAM STATION
Address:	520 EAST TAYLOR ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1213761 / 2013-01-09
Facility ID:	1213761
Facility Type:	ER
DER Facility ID:	432291
Site ID:	476969

PROJECT ORANGE (Continued) **1000790137**

DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	A3
SWIS:	3415
Spill Date:	2012-12-20
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2012-12-20
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	2012-12-20
Cleanup Meets Std:	False
Last Inspection:	2012-12-20
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2012-12-20
Spill Record Last Update:	2013-01-10
Spiller Name:	Not reported
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	JAMES MCCUMBER
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	12/20/2012 - Approx 1 gallon of 50% sulfuric acid released onto worker after flexible poly pipe burst, spraying area and worker. Worker immediately placed under water deluge shower, all clothing removed, and eyes rinsed. Approx 1 gallon of sulfuric acid flowed from water deluge area into nearby sanitary sewer. Site is not CBS regulated due to small bulk tank sizes (< 185 gallons), but chemical sulfuraic acid chemical is listed in part 597, so WEP and SU contacted hotline and Fire Department. FD and plant personnel placed sodium bicarb over acid sprayed to floor as well as into sewer in attmept to neutralize acid. Brazell notified for possible municipal notifcation requirement. KCKemp 1/9/2013 - Closure report received and filed. KCKemp
Remarks:	1 gallon possibly into floor drain - FD on scene now -

All Materials:

Site ID:	476969
Operable Unit ID:	1226782
Operable Unit:	01
Material ID:	2224144
Material Code:	0039A
Material Name:	sulfuric acid
Case No.:	07664939
Material FA:	Hazardous Material
Quantity:	1.00
Units:	G
Recovered:	.00
Resource Affected:	Sewer, Impervious Surface

PROJECT ORANGE (Continued) **1000790137**

Oxygenate:	Not reported
Name:	520 E.TAYLOR ST.
Address:	520 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9211857 / 1993-03-02
Facility ID:	9211857
Facility Type:	ER
DER Facility ID:	184663
Site ID:	212315
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	B3
SWIS:	3415
Spill Date:	1993-01-16
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1993-01-17
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	1993-03-02
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1993-01-19
Spill Record Last Update:	1993-03-02
Spiller Name:	Not reported
Spiller Company:	STEWART AND STEVENSON OP.
Spiller Address:	520 E.TAYLOR ST.
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0394313
Longitude:	-76.1434802
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 01/19/93: ALLWASH HIRED TO WIPE DOWN EQUIPMENT SURROUNDING TRANSFORMER.
Remarks:	TRNSFORMER EXPLODED. OIL IN UNIT VAPORIZED AND BURNED.

All Materials:

Site ID:	212315
Operable Unit ID:	976296
Operable Unit:	01
Material ID:	405241
Material Code:	0016A
Material Name:	non PCB oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	35.00
Units:	G
Recovered:	1.00
Resource Affected:	Soil
Oxygenate:	Not reported

PROJECT ORANGE (Continued) **1000790137**

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	Project Orange
Handler Address:	E Taylor St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYD987016136
Contact Name:	TRACY JONES
Contact Address:	E TAYLOR ST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-474-8230
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	E TAYLOR ST
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Project Orange Associates Lp
Owner Type:	Private
Operator Name:	Project Orange Associates Lp
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No

PROJECT ORANGE (Continued) **1000790137**

Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D002
Waste Description:	Corrosive Waste

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	PROJECT ORANGE ASSOCIATES LP
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	1100 TOWN & COUNTRY RD STE 800
Owner/Operator City,State,Zip:	ORANGE, CA 92668
Owner/Operator Telephone:	714-667-3800
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	PROJECT ORANGE ASSOCIATES LP
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	1100 TOWN & COUNTRY RD STE 800
Owner/Operator City,State,Zip:	ORANGE, CA 92668
Owner/Operator Telephone:	714-667-3800
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name:	PROJECT ORANGE ASSOCIATES LP
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	1100 TOWN & COUNTRY RD STE 800
Owner/Operator City,State,Zip:	ORANGE, CA 92668
Owner/Operator Telephone:	714-667-3800
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20060101

PROJECT ORANGE (Continued) **1000790137**

Handler Name: PROJECT ORANGE
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: PROJECT ORANGE
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920928
Handler Name: PROJECT ORANGE
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19960226
Handler Name: STEWART & STEVENSON OPERATIONS, INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 2211
NAICS Description: Electric Power Generation, Transmission And Distribution

NAICS Code: 22111
NAICS Description: Electric Power Generation

PROJECT ORANGE (Continued) **1000790137**

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

AIRS:

Name:	POA COGEN FAC/SYRACUSE UNIV STEAM STA
Address:	520 EAST TAYLOR STREET
City,State,Zip:	SYRACUSE, NY
DECID:	7311500229
Process ID:	E04EI
Latitude:	Not reported
Longitude:	Not reported
FIPS Code:	36067
Auth Type Code:	Not reported
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.0013
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	EI0001
Contamination:	1330207
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	LB
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.0071
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	EI0001
Contamination:	108883
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	LB
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.00000085
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	UP0001
Contamination:	SO2
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	TON
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0
Issue date:	Not reported
Expired Date:	Not reported

PROJECT ORANGE (Continued) **1000790137**

Emission Unit date:	UP0001
Contamination:	7440382
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	LB
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	UP0002
Contamination:	207089
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	LB
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	UP0002
Contamination:	205992
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	LB
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.0028
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	US0067
Contamination:	7440417
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	LB
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.000875
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	US0034
Contamination:	VOC
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	TON
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	9.23999977
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	US0034
Contamination:	NH3

PROJECT ORANGE (Continued) **1000790137**

EPA Control Code: Not reported
Control Eff: Not reported
Unit: LB

Permit Status: Not reported
Auth Status Code: Not reported
Emissions: 8
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: UP0001
Contamination: 71432
EPA Control Code: Not reported
Control Eff: Not reported
Unit: LB

Permit Status: Not reported
Auth Status Code: Not reported
Emissions: 0
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: UP0002
Contamination: 7439921
EPA Control Code: Not reported
Control Eff: Not reported
Unit: LB

AIRS Detail:
DECID: 7311500229
Facility Name: PROJECT ORANGE ASSOCIATES
Auth Type: Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 18.5630182001685

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 14099.232

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 1581.9300000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000074986
Contaminant: PROPANE

PROJECT ORANGE (Continued) **1000790137**

Amount(Lbs/Yr): 401.81196203313499

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount(Lbs/Yr): 60.1188

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 9.1562734104403201E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 0.00426925209660206

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 0.00142430919717961

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 2.1070518105251299

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 1.2208364547253801E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount(Lbs/Yr): 48.095039999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 155981

PROJECT ORANGE (Continued) **1000790137**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 2974.3603638999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 527.37820016849003

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 920.02368000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 15.549696000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 11143.9488

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount(Lbs/Yr): 51.832320000000003

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount(Lbs/Yr): 37.578431999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 1.6845504

Issue Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Expiration Date: Not reported
Year: 2009
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount(Lbs/Yr): 41.465856000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount(Lbs/Yr): 0.55719744000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000107028
Contaminant: ACROLEIN
Amount(Lbs/Yr): 8.2931711999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 168.45504

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 142538880

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 36070

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount(Lbs/Yr): 82.931712000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 726

Issue Date: Not reported
Expiration Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Year: 2009
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 8552.3328000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 34147.667200000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 76900

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 2561.62834496

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount(Lbs/Yr): 43.586129999999997

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount(Lbs/Yr): 0.64627710000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000107028
Contaminant: ACROLEIN
Amount(Lbs/Yr): 9.6190079999999991

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 196.23995041932

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009

PROJECT ORANGE (Continued) **1000790137**

CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 652.944438303845

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 452.03845728727703

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 1.2208364547253801E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 226562700

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 2.5434092806778702E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 6.1041822736268797E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 9.1562734104403201E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 1.5260455684067201E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000207089

PROJECT ORANGE (Continued) **1000790137**

Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 4.5203845728727699E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 4.5203845728727699E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 23875.790000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount(Lbs/Yr): 96.190079999999995

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.25434092806778702

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.19329910533151801

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 0.13225728259524899

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.55955004174913103

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS

PROJECT ORANGE (Continued) **1000790137**

Amount(Lbs/Yr): 1.0682318978847001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.101736371227115

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 2.2382001669965201

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 6.1041822736268804E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.55955004174913103

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.71215459858980301

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 0.0427292759153882

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.432379577715237

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 1.1699682691118201

PROJECT ORANGE (Continued) **1000790137**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 14.751773827931601

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 1133.5

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 1632.96

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 1.2208364547253801E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 1122.6600000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.30135897152485103

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 13785.5841066304

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 45637.180044799999

Issue Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Expiration Date: Not reported
Year: 2009
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 1085.9436357203001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.0135897152485102E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.0135897152485102E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 4.5203845728727699E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 4.3762508960156496E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 0.15771793496112399

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount(Lbs/Yr): 72.104208

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 540.59569891957995

Issue Date: Not reported
Expiration Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Year: 2008
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 1350.5966000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 1.4543095842565299E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 5.0900835448978499E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 411.882437272061

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 1.39371335157917

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 669.30896056709901

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007782505
Contaminant: CHLORINE
Amount(Lbs/Yr): 0.24097209999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 75418.799396311399

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008

PROJECT ORANGE (Continued) **1000790137**

CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.83831227954046E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount(Lbs/Yr): 79.563264000000004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 17522.873599999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 5.1614684193106804E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.23104842417395

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 30.376819698919601

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 5.2058705842565299E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.87182945748297402

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000107028

PROJECT ORANGE (Continued) **1000790137**

Contaminant: ACROLEIN
Amount(Lbs/Yr): 15.9126528

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN
Amount(Lbs/Yr): 216406.70000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 2.6662342378036299

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 1.4543095842565301E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 22779.4172

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 463.367741931068

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 5.41082641931068E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 3.0298116338677702E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000086737
Contaminant: FLUORENE

PROJECT ORANGE (Continued) **1000790137**

Amount(Lbs/Yr): 0.00169669451496595

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 1.0907321881924001E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.667173569450908

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007446119
Contaminant: SULFUR TRIOXIDE
Amount(Lbs/Yr): 478.03050000000002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 21029.214383479

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 1.2735272662244601

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 21727.349999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.56745564775752

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 324.101010179203

PROJECT ORANGE (Continued) **1000790137**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 7.2715479212826395E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 17.573131116433

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount(Lbs/Yr): 1.0691313600000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 346374720

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 3.4079058092099701

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 1988.088

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 1.0907321881924001E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 1882.6300000000001

Issue Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Expiration Date: Not reported
Year: 2008
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.30891182795404598

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.12142728735471101

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.66655855945090803

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount(Lbs/Yr): 99.454080000000005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 4.6336774193106803E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 1787.3005892471299

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.0891182795404602E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.37342776338677702

Issue Date: Not reported
Expiration Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Year: 2008
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 7.4113229212826402E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount(Lbs/Yr): 159.12652800000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 4929.6454707966004

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 1.9721985803206601E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 3.4707208509727599E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 0.0142561625572363

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 0.65357135053999604

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 2.9700338660908899E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007

PROJECT ORANGE (Continued) **1000790137**

CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 0.118863934643636

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 1.2476824237581801

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 4.9168545388780698E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 22739.680876458198

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 10981.7752

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 2.4254062557236299E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 33.737384148920199

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 17.226256023327199

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000100414

PROJECT ORANGE (Continued) **1000790137**

Contaminant: ETHYLBENZENE
Amount(Lbs/Yr): 88.346688

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 5.4131912764591398E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 2.61362980215999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.225931173822908

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 1982.5993453185799

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 751.98951771076395

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 25114.202399999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.347072085097276

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 0NY210000
Contaminant: OXIDES OF NITROGEN

PROJECT ORANGE (Continued) **1000790137**

Amount(Lbs/Yr): 225074

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 1.0692121917927201E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007782505
Contaminant: CHLORINE
Amount(Lbs/Yr): 6.4218999999999998E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 5.2060812764591303E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 3.7704742099244499

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 1.6632189650108999E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 1315.2940000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 28098.759999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount(Lbs/Yr): 176.693376

PROJECT ORANGE (Continued) **1000790137**

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount(Lbs/Yr): 80.064186000000007

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 1.8231443196545401E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000107028
Contaminant: ACROLEIN
Amount(Lbs/Yr): 17.669337599999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 375223740

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 1919.4400000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 7.1280812786181401E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 462.76278012970101

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 5.3467372764591395E-4

Issue Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Expiration Date: Not reported
Year: 2007
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 0.65340745053999705

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000075070
Contaminant: ACETALDEHYDE
Amount(Lbs/Yr): 110.43335999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 7.1653312786181403E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007446119
Contaminant: SULFUR TRIOXIDE
Amount(Lbs/Yr): 127.395

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 359.891790907776

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 1.0692121917927201E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000106990
Contaminant: 1,3-BUTADIENE
Amount(Lbs/Yr): 1.1871586199999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 5472.0460251373997

Issue Date: Not reported
Expiration Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Year: 2007
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 0.154486461036727

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 0.049896568950327

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 80091.310262045998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 607.37614892023203

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.83786748250544996

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.31577738660908899

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 1.36621557840181

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 1847.9100000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007

PROJECT ORANGE (Continued) **1000790137**

CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 0.00142561625572363

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 520.60812764591299

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.51886705723545201

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 3.6703808509727599E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007446119
Contaminant: SULFUR TRIOXIDE
Amount(Lbs/Yr): 204.2595

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.82467778352829901

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 1.3165050741673499E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 26925.144680000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 025321226

PROJECT ORANGE (Continued) **1000790137**

Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.249537576976195

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 001330207
Contaminant: XYLENE, M, O & P MIXT.
Amount(Lbs/Yr): 193.86973939999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007782505
Contaminant: CHLORINE
Amount(Lbs/Yr): 0.1029659

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 22725.288321224001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007439965
Contaminant: MANGANESE
Amount(Lbs/Yr): 0.13658557206119701

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 36.819374759708403

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 8.4851200450040802E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 1.5776444554454401

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000108883
Contaminant: TOLUENE

PROJECT ORANGE (Continued) **1000790137**

Amount(Lbs/Yr):	394.500112534766
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	4.3623916966693804E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.32715715434741499
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	0.39467390386135998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000075070
Contaminant:	ACETALDEHYDE
Amount(Lbs/Yr):	121.16444568
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	7.1811449611156403E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	14638.74
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000074840
Contaminant:	ETHANE
Amount(Lbs/Yr):	1114.45
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	540.66475011508896

PROJECT ORANGE (Continued) **1000790137**

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	374.30636546429298
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000191242
Contaminant:	BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr):	4.5439706966693801E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.75339669191714198
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	8.6053333933387693E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000106990
Contaminant:	1,3-BUTADIENE
Amount(Lbs/Yr):	1.3025060340000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	0.39441111386136002
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	223112.17999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	4.0782545782962298
Issue Date:	Not reported

PROJECT ORANGE (Continued) **1000790137**

Expiration Date: Not reported
Year: 2006
CAS #: 000107028
Contaminant: ACROLEIN
Amount(Lbs/Yr): 19.386478312000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000115071
Contaminant: PROPYLENE
Amount(Lbs/Yr): 0.121086

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 5.3058356738294298E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 797.1114

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 2167.3957408210099

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 3.0118666876685699E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 1.5594755625561901E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 2.9270397697619499E-4

Issue Date: Not reported
Expiration Date: Not reported

PROJECT ORANGE (Continued) **1000790137**

Year: 2006
CAS #: 0NY998100
Contaminant: UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 9016.7028232839002

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 4.7391546546429302E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 332.71676930159299

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.51201158127809498

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 2.6455397697619498E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000075569
Contaminant: PROPANE, 1,2-EPOXY-
Amount(Lbs/Yr): 87.8434302

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 9.1391533933387703E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000205992
Contaminant: BENZO[B]FLUORANTHENE
Amount(Lbs/Yr): 6.9357400450040805E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006

PROJECT ORANGE (Continued) **1000790137**

CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 2.4635523393338798E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 7058.6509999999998

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 4.2385336546429302E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 1.9537917902789099E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 1169.5119999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 0NY075105
Contaminant: UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr): 85081.554784946202

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440666
Contaminant: ZINC
Amount(Lbs/Yr): 10.398206743617701

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 436.69075970834098

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000124389

PROJECT ORANGE (Continued) **1000790137**

Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 376346224

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000207089
Contaminant: BENZO[K]FLUORANTHENE
Amount(Lbs/Yr): 3.8376756546429298E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000100414
Contaminant: ETHYLBENZENE
Amount(Lbs/Yr): 96.9306816

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 9.3296115094503307E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 0.20937917902789099

AIRS Emissions:
County: ONONDAGA
Municipality: SYRACUSE
Facility ID: 7311500229
Facility Name: PROJECT ORANGE ASSOCIATES
SIC Code: 4931

Year: 2015
VOC(tons): 0
NOx(tons): 0
Co(tons): 0
Co2(tons): 0
Particulates: 0
PM10(tons): 0
PM2.5(tons): 0
HAPS: 0
So2: 0

Year: 2010
VOC(tons): 1.95
NOx(tons): 38.45
Co(tons): 18.04
Co2(tons): 75804.77
Particulates: 21.35
PM10(tons): 21.35
PM2.5(tons): 4.28

PROJECT ORANGE (Continued) **1000790137**

HAPS: 0
So2: 0.36

Click this hyperlink while viewing on your computer to access
217 additional NY AIRS: record(s) in the EDR Site Report.

NY MANIFEST:
EPA ID: NYD987016136
Country: USA
Name: Project Orange Assoc Llc
Address: 520 E TAYLOR ST
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported
Location Address 1: 520 EAST TAYLOR STREET
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: Project Orange Assoc Llc
Mailing Contact: Joseph E Murphy
Mailing Address 1: 434 E BRIGHTON AVE
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13210
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154748230

Manifest Data:
Document ID: NYG0926829
Manifest Status: Not reported
Trans1 State ID: AM8365
Year: 1997
Trans2 State ID: Not reported
Generator Ship Date: 08/19/1997
Trans1 Recv Date: 08/19/1997
Trans2 Recv Date: Not reported
TSD Site Recv Date: 08/19/1997
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD987016136
Trans1 EPA ID: NYD013277454
Trans2 EPA ID: Not reported
TSDF ID 1: NYD013277454
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported

PROJECT ORANGE (Continued) **1000790137**

Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Cadmium
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00220
Units:	Gallons (liquids only)
Number of Containers:	004
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG1656369
Manifest Status:	Not reported
Trans1 State ID:	49187AK
Year:	1999
Trans2 State ID:	TLK5558OH
Generator Ship Date:	06/15/1999
Trans1 Recv Date:	06/15/1999
Trans2 Recv Date:	06/17/1999
TSD Site Recv Date:	06/18/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	OHD001926740
TSDF ID 1:	OHD001926740
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Mercury
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00075
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

PROJECT ORANGE (Continued) **1000790137**

Document ID:	NYG1658025
Manifest Status:	Not reported
Trans1 State ID:	AM8365
Year:	1999
Trans2 State ID:	Not reported
Generator Ship Date:	08/05/1999
Trans1 Recv Date:	08/05/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/05/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Cadmium
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00110
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG0222624
Manifest Status:	Not reported
Trans1 State ID:	Not reported
Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	05/30/1997
Trans1 Recv Date:	05/30/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/30/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported

PROJECT ORANGE (Continued) **1000790137**

Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Wastewater Treatment Sludges From Electroplating Operations, Except From The Following Processes: (1) Sulfuric Acid Anodizing Of Aluminum; (2) Tin Plating On Carbon Steel; (3) Zinc Plating (Segregated Basis) On Carbon Steel; (4) Aluminum Or Zinc-Aluminum Plating On Carbon Steel; (5) Cleaning/Stripping Associated With Tin, Zinc, And Aluminum Plating On Carbon Steel; And (6) Chemical Etching And Milling Of Aluminum.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00165
Units:	Gallons (liquids only)
Number of Containers:	003
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG0221526
Manifest Status:	Not reported
Trans1 State ID:	HU7905
Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	04/17/1997
Trans1 Recv Date:	04/17/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/17/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported

PROJECT ORANGE (Continued) **1000790137**

Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Cadmium
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00650
Units:	Pounds
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG0222084
Manifest Status:	Not reported
Trans1 State ID:	AM8365
Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	04/24/1997
Trans1 Recv Date:	04/24/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/24/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Cadmium
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00110
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG0222147

PROJECT ORANGE (Continued) **1000790137**

Manifest Status:	Not reported
Trans1 State ID:	HU7905
Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	04/25/1997
Trans1 Recv Date:	04/25/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/25/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	The Following Spent Nonhalogenated Solvents: Xylene, Acetone, Ethyl Acetate, Ethyl Benzene, Ethyl Ether, Methyl Isobutyl Ketone, N-Butyl Alcohol, Cyclohexanone, And Methanol; All Spent Solvent Mixtures/Blends Containing, Before Use, Only The Above Spent Nonhalogenated Solvents; And All Spent Solvent Mixtures/Blends Containing, Before Use, One Or More Of The Above Nonhalogenated Solvents, And A Total Of Ten Percent Or More (By Volume) Of One Or More Of Those Solvents Listed In F001, F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00018
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	NJD071629976
Generator Ship Date:	12/17/2010
Trans1 Recv Date:	12/17/2010
Trans2 Recv Date:	12/21/2010

PROJECT ORANGE (Continued) **1000790137**

TSD Site Recv Date:	12/31/2010
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	KYD053348108
TSDF ID 2:	Not reported
Manifest Tracking Number:	003842193FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H061
Waste Code a:	Trichlorethylene
Waste Code b:	The Following Spent Halogenated Solvents: Tetrachloroethylene, Methylene Chloride, Trichloroethylene, 1,1,1-Trichloroethane, Chlorobenzene, 1,1,2-Trichloro-1,2,2-Trifluoroethane, Ortho-Dichlorobenzene, Trichlorofluoromethane, And 1,1,2, Trichloroethane; All Spent Solvent Mixtures/Blends Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Halogenated Solvents Or Those Solvents Listed In F001, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	7600
Units:	Pounds
Number of Containers:	4
Container Type:	Portable tanks
Handling Method:	Burn
Specific Gravity:	1
Document ID:	NYG0345717
Manifest Status:	Not reported
Trans1 State ID:	EZ1099
Year:	1998
Trans2 State ID:	Not reported
Generator Ship Date:	01/27/1998
Trans1 Recv Date:	01/27/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/27/1998
Part A Recv Date:	Not reported

PROJECT ORANGE (Continued) **1000790137**

Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Cadmium
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00055
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG0346968
Manifest Status:	Not reported
Trans1 State ID:	MX3142
Year:	1998
Trans2 State ID:	Not reported
Generator Ship Date:	03/06/1998
Trans1 Recv Date:	03/06/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	03/06/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported

PROJECT ORANGE (Continued) **1000790137**

Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Cadmium
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00110
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG0347661
Manifest Status:	Not reported
Trans1 State ID:	EZ1099
Year:	1998
Trans2 State ID:	Not reported
Generator Ship Date:	04/10/1998
Trans1 Recv Date:	04/10/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/10/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD987016136
Trans1 EPA ID:	NYD013277454
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Cadmium
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00110
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

PROJECT ORANGE (Continued) **1000790137**

Click this hyperlink while viewing on your computer to access
64 additional NY MANIFEST: record(s) in the EDR Site Report.

28
ENE
< 1/8
0.095 mi.
504 ft.

SYRACUSE HOUSING AUTH - PIONEER HOMES BLDG 60 **RCRA-VSQG** **1012186551**
101-102 DYER COURT **NYR000164129**
SYRACUSE, NY 13202

Relative:
Higher

Actual:
407 ft.

RCRA Listings:

Date Form Received by Agency:		20090415
Handler Name:		Syracuse Housing Auth - Pioneer Homes Bldg 60
Handler Address:		Dyer Court
Handler City,State,Zip:		SYRACUSE, NY 13202
EPA ID:		NYR000164129
Contact Name:		WILLIAM W GEHRKE
Contact Address:		BURT ST
Contact City,State,Zip:		SYRACUSE, NY 13202
Contact Telephone:		315-470-4315
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		02
Land Type:		Other
Federal Waste Generator Description:		Conditionally Exempt Small Quantity Generator
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Handler Activities
State District Owner:		Ny
State District:		NYSDEC R7
Mailing Address:		DYER COURT
Mailing City,State,Zip:		SYRACUSE, NY 13202
Owner Name:	Syracuse Housing Authority	
Owner Type:		Other
Operator Name:	Syracuse Housing Authority	
Operator Type:		Other
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
202 GPRA Corrective Action Baseline:		No

SYRACUSE HOUSING AUTH - PIONEER HOMES BLDG 60 (Continued) **1012186551**

Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name:	SYRACUSE HOUSING AUTHORITY
Legal Status:	Other
Date Became Current:	19540101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name:	SYRACUSE HOUSING AUTHORITY
Legal Status:	Other
Date Became Current:	19540101
Date Ended Current:	Not reported
Owner/Operator Address:	516 BURT ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20090415
Handler Name:	SYRACUSE HOUSING AUTH - PIONEER HOMES BLDG 60
Federal Waste Generator Description:	Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No

SYRACUSE HOUSING AUTH - PIONEER HOMES BLDG 60 (Continued) **1012186551**

Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 92511
NAICS Description: Administration Of Housing Programs

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

C29 **THE SALVATION ARMY** **UST FINDER** **1028588420**
WSW **1105 S. STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.097 mi.
511 ft. **Site 2 of 9 in cluster C**

Relative: **Lower**
Actual: **399 ft.**

UST FINDER:
Object ID: 318213
Facility ID: NY44653
Name: THE SALVATION ARMY
Address: 1105 S. STATE ST
City,State,Zip: SYRACUSE, NY 13202
Address Match Type: Not reported
Open USTs: 0
Closed USTs: 1
TOS USTs: 0
Population 1500ft: 2276
Private Wells 1500ft: 0
Within 100yr Floodplain: No
Land Use: Developed, Medium Intensity
Within SPA: No
SPA PWS Facility ID: Not reported
SPA Water Type: Not reported
SPA Facility Type: Not reported
SPA HUC12: Not reported
Within WHPA: No
WHPA PWS Facility ID: Not reported
WHPA Water Type: Not reported
WHPA Facility Type: Not reported
WHPA HUC12: Not reported
Facility Status: Closed UST(s)
Date of Last Inspection: Not reported
EPA Region: 2
Tribe: Not reported
Coordinate Source: State
X Coord: -76.147364
Y Coord: 43.039134
Latitude: 43.039134
Longitude: -76.147364

THE SALVATION ARMY (Continued) **1028588420**

UST FINDER:

Object ID:	1276629
Facility ID:	NY44653
Tank ID:	NY70277
Tank Status:	Closed
Installation Date:	1986/12/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	5000
Substances:	Not reported
Tank Wall Type:	Not reported

C30 **FORMER SALVATION ARMY** **UST FINDER RELEASE** **1029076786**
WSW **1105 SOUTH STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 0**
0.097 mi.
511 ft. **Site 3 of 9 in cluster C**

Relative: **Lower**

Actual: **399 ft.**

UST FINDER RELEASE:

Object ID:	249485
Facility ID:	NY59475
Lust ID:	NY404882
Name:	FORMER SALVATION ARMY
Address:	1105 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	2004/08/04 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	2276
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1473599999999
Y Coord:	43.0391300000001
Latitude:	43.03913
Longitude:	-76.14736

C31 **EAST ADAMS REDEVELOPMENT - PHASE II AREA** **NY BROWNFIELDS** **S131764066**
WSW **1105-1117 SOUTH STATE STREET** **NY PFAS** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.097 mi.
511 ft. **Site 4 of 9 in cluster C**

Relative: **Lower**
Actual: **399 ft.**

BROWNFIELDS:

Name:	EAST ADAMS REDEVELOPMENT - PHASE II AREA
Address:	1105-1117 SOUTH STATE STREET
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	659420
Acres:	2.540
HW Code:	C734163
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	12/06/2023
Record Updated Date:	01/08/2025
Update By:	GWPRISCO
Site Description:	"Location: The East Adams Redevelopment Phase II Area site (site) is located at 1105 1117 South State Street and is a 2.540-acre site located in an urban area within the City of Syracuse. The site is bound by a railroad to the north, Oakwood Avenue to the east, Burt Street to the south, and South State Street to the west. Site Features: The site is relatively flat with the topography of the surrounding area gently sloping towards the west-southwest. The site consists of a gravel lot and has no existing buildings at this time. Current Zoning and Land Use: The site is currently inactive and is located within a MX-2: Neighborhood Center District. The surrounding parcels are currently used for a combination of commercial, residential, and religious uses. Past Use of the Site: Historical site uses included both residential and commercial purposes including some petroleum storage use as early as 1910. By 1951, the southwestern portion of the site was developed with a gasoline station and automotive repair business. Additional uses of the site included a scrap yard, paper bailing, metal bailing, and most recently a Salvation Army warehouse, which was present from 1961 to 2003. In the early 2000s, the former buildings were demolished, and the site was configured into its current state as a gravel parking lot. Site Geology and Hydrogeology: The site elevation ranges from 397 to 399 feet above mean sea level. The site is underlain by a fill layer that extends to between about 1.5 and 9.5 feet below ground surface (ft bgs). The fill predominantly consists of tan to dark brown fine-grained sand with varying amounts of silt, clay, gravel, brick, concrete, fibrous vegetation, roots, construction debris, glass, asphalt, wood, coal, slag, and metal. The fill layer is underlain by native soil that predominantly consists of gray to brown fine-grained sand with varying amounts of clay, silt, and gravel. Bedrock was not encountered at soil boring depths down to 23 ft bgs. Groundwater depth ranges from approximately 7.93 to 11.48 ft bgs. The groundwater elevation is highest in the northeastern part of the site. Generalized groundwater flow at the site is to the southwest. "
Env Problem:	"Nature and Extent of Contamination: Soil and groundwater were analyzed for volatile organic compounds (VOCs), semi-volatile organic compounds (SVOCs), metals, polychlorinated biphenyls (PCBs), per- and polyfluoroalkyl substances (PFAS), herbicides, and pesticides. Soil vapor samples and an outdoor air sample were analyzed for VOCs. Based upon investigations conducted to date, the primary contaminants of concern include VOCs, SVOCs, and metals in soil as well as PFOS and

EAST ADAMS REDEVELOPMENT - PHASE II AREA (Continued) **S131764066**

PFOA in groundwater. VOCs are primary contaminants of concern in soil vapor as well. Soils: Nine VOCs were detected at concentrations exceeding the unrestricted use soil cleanup objectives (UUSCOs), protection of groundwater soil cleanup objectives (PGSCOs), and/or restricted residential soil cleanup objectives (RRSCOs)(SCOs). All VOC detections were in the northwest corner of the site. Six VOCs were detected at concentrations exceeding UUSCOs which include: acetone at a maximum concentration of 0.42 parts per million (ppm) (UUSCO 0.05ppm), ethylbenzene at a maximum concentration of 39 ppm (UUSCO 1.0 ppm), naphthalene at a maximum concentration of 58 ppm (UUSCO 12 ppm), n-butylbenzene at a maximum concentration of 20 ppm (UUSCO 12 ppm), n-propylbenzene at a maximum concentration of 52 ppm (UUSCO 3.9 ppm), and sec-butylbenzene at a maximum concentration of 13 ppm (UUSCO 11 ppm). Two VOCs detected at concentrations exceeding RRSCOs include: 1,2,4- trimethylbenzene which was detected at a maximum concentration of 380 ppm (RRSCO 52 ppm) and total xylenes with a maximum concentration of 180 ppm (RRSCO 100 ppm). One VOC, 1,3,5- trimethylbenzene (mesitylene), was detected at concentrations exceeding the PGSCO with a maximum concentration of 120 ppm (PGSCO 8.4 ppm). SVOCs detected sitewide at concentrations exceeding the PGSCOs occurred for two constituents which include benzo(a)anthracene at a maximum concentration of 6.6 ppm (PGSCO 1.0 ppm) and benzo(b)fluoranthene at a maximum concentration of 8.2 ppm (PGSCO 1.7 ppm). Four SVOCs were detected at concentrations exceeding RRSCOs which include: benzo(a)pyrene at a maximum concentration of 6.8 ppm (RRSCO 1.0 ppm), chrysene at a maximum concentration of 6.4 ppm (RRSCO 3.9 ppm), dibenz(a,h)anthracene at a maximum concentration of 1.0 ppm (RRSCO 0.33 ppm), and indeno(1,2,3- cd)pyrene at a maximum concentration of 4.6 ppm (RRSCO 0.5 ppm). One SVOC, benzo(k)fluoranthene was detected in eight samples at a concentration exceeding the UUSCO with a maximum concentration of 2.6 ppm (UUSCO 0.8 ppm). Four pesticides were detected at concentrations exceeding UUSCOs which include: 4,4'-DDD at a maximum concentration of 0.0412 ppm (UUSCO 0.0033 ppm), 4,4'-DDE at a maximum concentration of 0.12 ppm (UUSCO 0.0033 ppm), 4,4'-DDT at a maximum concentration of 1.19ppm (UUSCO 0.0033 ppm), and dieldrin at a maximum concentration of 0.0261 ppm (UUSCO 0.005 ppm). Four metals were detected at concentrations exceeding UUSCOs which include: hexavalent chromium at a maximum concentration of 4.64 ppm (UUSCO 1.0 ppm), trivalent chromium at a maximum concentration of 74.5 ppm (UUSCO 30 ppm), nickel at a maximum concentration of 81.9 ppm (UUSCO 30 ppm), and zinc at a maximum concentration of 2620 ppm (UUSCO 109 ppm). Six metals were detected sitewide at concentrations exceeding RRSCOs include: arsenic which was detected at a maximum concentration of 19.9 ppm (RRSCO 16 ppm), barium with a maximum concentration of 785 ppm (RRSCO 400 ppm), cadmium with a maximum concentration of 7.66 ppm (RRSCO 4.3 ppm), copper with a maximum concentration of 1390 ppm (RRSCO 270 ppm), lead with a maximum concentration of 1660 ppm (RRSCO 400 ppm), and mercury with a maximum concentration of 68 ppm (RRSCO 0.81 ppm), One metal, manganese, was detected at concentrations exceeding the PGSCOs with a maximum concentration of 3290 ppm (PGSCO 2000 ppm). Perfluorooctanesulfonic acid (PFOS) was detected in eight soil sample above UUSCOs and in seven soil samples above PGSCOs with a maximum concentration of 0.00293 parts per billion (ppb) compared to the PGSCO of 0.001 ppb. Perfluorooctanoic acid (PFOA) was not detected in concentrations exceeding the PGSCO. There were no herbicides detected in soil at concentrations exceeding applicable

EAST ADAMS REDEVELOPMENT - PHASE II AREA (Continued) **S131764066**

SCOs. Data does not indicate that there are off-site impacts in soil related to this site. Groundwater: Groundwater sample results were compared to the NYS Ambient Water Quality Standards and Guidance Values (groundwater SCGs). VOCs exceeding applicable groundwater standards, criteria, and guidance (SCGs) occurred in three out of 11 groundwater monitoring wells across the site including 1,2,4,5-tetramethylbenzene at a maximum concentration of 8.9 ppb (SCG 5 ppb) and 1,3,5- trimethylbenzene (mesitylene) at a maximum concentration of 11 ppb (SCG 5 ppb). SVOCs exceeding groundwater SCGs occurred in two out of 11 groundwater monitoring wells across the site including benzo(a)anthracene at a maximum concentration of 0.03 ppb (SCG 0.002 ppb), benzo(b)fluoranthene at a maximum concentration of 0.03 ppb SCG 0.002 ppb), and phenol at a maximum concentration of 2.7 (SCG 1.0 ppb). Five metals in both the dissolved phase and in total exceeded groundwater SCGs throughout the site which include: iron at a maximum concentration of 2,220 ppb (dissolved) and 8,330 ppb (total) (SCG 300 ppb), magnesium at a maximum concentration of 52,400 ppb (dissolved) and 52,600 ppb (total) (SCG 3000 ppb), manganese at a maximum concentration of 13,190 ppb (dissolved) and 13,850 ppb (total) (SCG 300 ppb), selenium at a maximum concentration of 14.4 ppb (dissolved) and 14.6 ppb (total) (SCG 10 ppb), and sodium at a maximum concentration of 208,000 ppb (dissolved) and 220,000 ppb (total) (SCG 20,000 ppb). PFOS was detected in three out of 11 groundwater monitoring wells at concentrations above the applicable groundwater SCG with a maximum detection of 0.0124 ppb (SCG 0.0027 ppb). PFOA and 1,4 Dioxane were not detected in the groundwater monitoring samples above applicable groundwater SCGs. No pesticides, herbicides, or PCBs were detected at concentrations above groundwater SCGs. Data does not indicate that there are off-site impacts in groundwater related to this site. Soil Vapor: Various petroleum VOCs were detected sitewide in the soil vapor samples, most notably hexane at a maximum concentration of 916 micrograms per cubic meter (g/m3). Several chlorinated solvents were detected in the soil vapor samples, most notably tetrachloroethylene at a maximum concentration of 564 g/m3. Data does not indicate any off-site impacts in soil vapor related to this site. "

Health Problem: "The site is completely fenced which restricts public access. Persons who enter the site may come into contact with contaminants in soil by digging below surface soil or otherwise disturbing soil beneath the packed gravel surface. Contaminated groundwater at the site is not used for drinking or other purposes, since the site is served by a public water supply that obtains its water from a source not affected by site contamination. Volatile organic compounds in soil vapor (air spaces within the soil) may move into buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Soil vapor intrusion is not a current concern on-site because the site is vacant; however, the potential exists for the inhalation of site contaminants due to soil vapor intrusion in any future on-site buildings. Environmental sampling indicates that soil vapor intrusion is not a concern for off-site buildings."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False

EAST ADAMS REDEVELOPMENT - PHASE II AREA (Continued) **S131764066**

Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2024-03-13 10:07:00
Record Upd:	2024-03-14 08:33:00
Updated By:	AYRUSSO
Own Op:	4
Sub Type:	C01
Owner Name:	William J. Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Allyson Carpenter
Owner Company:	East Adams Phase II, L.P.
Owner Address:	100 North Broadway, Suite 100
Owner Addr2:	Not reported
Owner City,St,Zip:	St. Louis, MO 63102
Owner Country:	United States of America
Own Op:	1
Sub Type:	C01
Owner Name:	William J. Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Dan Smith
Owner Company:	Onondaga County Public Library Central Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America
HW Code:	C734163
Waste Type:	1,2,4-trimethylbenzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734163
Waste Type:	chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734163
Waste Type:	dibenz[a,h]anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734163
Waste Type:	benzo(a)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734163
Waste Type:	lead

EAST ADAMS REDEVELOPMENT - PHASE II AREA (Continued) **S131764066**

Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734163
Waste Type:	benzo(b)fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734163
Waste Type:	mercury
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734163
Waste Type:	perfluorooctane sulfonic acid
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734163
Waste Type:	perfluorooctanoic acid
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734163
Waste Type:	1,3,5-trimethylbenzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734163
Waste Type:	indeno(1,2,3-cd)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734163
Waste Type:	xylene (mixed)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734163
Waste Type:	polychlorinated biphenyls (PCB)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734163
Waste Type:	benzo(a)anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	2208975
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2024-08-22 09:39:00
Record Updated:	2024-08-22 09:39:00
Updated By:	CFNORRIS

PFAS 3:

Name:	EAST ADAMS REDEVELOPMENT - PHASE II AREA
Address:	1105-1117 SOUTH STATE STREET
City,State,Zip:	SYRACUSE, NY 13202
Site Code:	659420
HW Code:	C734163
Program:	BCP
Class Code:	A
Region:	7
Acres:	2.540
Date Record Added:	12/06/2023
Date Record Updated:	01/08/2025

EAST ADAMS REDEVELOPMENT - PHASE II AREA (Continued) **S131764066**

Water Quantity: UNKNOWN
Updated By: GWPRISCO
Site Description: "Location: The East Adams Redevelopment Phase II Area site (site) is located at 1105 1117 South State Street and is a 2.540-acre site located in an urban area within the City of Syracuse. The site is bound by a railroad to the north, Oakwood Avenue to the east, Burt Street to the south, and South State Street to the west. Site Features: The site is relatively flat with the topography of the surrounding area gently sloping towards the west-southwest. The site consists of a gravel lot and has no existing buildings at this time. Current Zoning and Land Use: The site is currently inactive and is located within a MX-2: Neighborhood Center District. The surrounding parcels are currently used for a combination of commercial, residential, and religious uses. Past Use of the Site: Historical site uses included both residential and commercial purposes including some petroleum storage use as early as 1910. By 1951, the southwestern portion of the site was developed with a gasoline station and automotive repair business. Additional uses of the site included a scrap yard, paper bailing, metal bailing, and most recently a Salvation Army warehouse, which was present from 1961 to 2003. In the early 2000s, the former buildings were demolished, and the site was configured into its current state as a gravel parking lot. Site Geology and Hydrogeology: The site elevation ranges from 397 to 399 feet above mean sea level. The site is underlain by a fill layer that extends to between about 1.5 and 9.5 feet below ground surface (ft bgs). The fill predominantly consists of tan to dark brown fine-grained sand with varying amounts of silt, clay, gravel, brick, concrete, fibrous vegetation, roots, construction debris, glass, asphalt, wood, coal, slag, and metal. The fill layer is underlain by native soil that predominantly consists of gray to brown fine-grained sand with varying amounts of clay, silt, and gravel. Bedrock was not encountered at soil boring depths down to 23 ft bgs. Groundwater depth ranges from approximately 7.93 to 11.48 ft bgs. The groundwater elevation is highest in the northeastern part of the site. Generalized groundwater flow at the site is to the southwest. "

Summary: "The site is completely fenced which restricts public access. Persons who enter the site may come into contact with contaminants in soil by digging below surface soil or otherwise disturbing soil beneath the packed gravel surface. Contaminated groundwater at the site is not used for drinking or other purposes, since the site is served by a public water supply that obtains its water from a source not affected by site contamination. Volatile organic compounds in soil vapor (air spaces within the soil) may move into buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Soil vapor intrusion is not a current concern on-site because the site is vacant; however, the potential exists for the inhalation of site contaminants due to soil vapor intrusion in any future on-site buildings. Environmental sampling indicates that soil vapor intrusion is not a concern for off-site buildings."

Summary: "Nature and Extent of Contamination: Soil and groundwater were analyzed for volatile organic compounds (VOCs), semi-volatile organic compounds (SVOCs), metals, polychlorinated biphenyls (PCBs), per- and polyfluoroalkyl substances (PFAS), herbicides, and pesticides. Soil

EAST ADAMS REDEVELOPMENT - PHASE II AREA (Continued) **S131764066**

vapor samples and an outdoor air sample were analyzed for VOCs. Based upon investigations conducted to date, the primary contaminants of concern include VOCs, SVOCs, and metals in soil as well as PFOS and PFOA in groundwater. VOCs are primary contaminants of concern in soil vapor as well. Soils: Nine VOCs were detected at concentrations exceeding the unrestricted use soil cleanup objectives (UUSCOs), protection of groundwater soil cleanup objectives (PGSCOs), and/or restricted residential soil cleanup objectives (RRSCOs)(SCOs). All VOC detections were in the northwest corner of the site. Six VOCs were detected at concentrations exceeding UUSCOs which include: acetone at a maximum concentration of 0.42 parts per million (ppm) (UUSCO 0.05ppm), ethylbenzene at a maximum concentration of 39 ppm (UUSCO 1.0 ppm), naphthalene at a maximum concentration of 58 ppm (UUSCO 12 ppm), n-butylbenzene at a maximum concentration of 20 ppm (UUSCO 12 ppm), n-propylbenzene at a maximum concentration of 52 ppm (UUSCO 3.9 ppm), and sec-butylbenzene at a maximum concentration of 13 ppm (UUSCO 11 ppm). Two VOCs detected at concentrations exceeding RRSCOs include: 1,2,4- trimethylbenzene which was detected at a maximum concentration of 380 ppm (RRSCO 52 ppm) and total xylenes with a maximum concentration of 180 ppm (RRSCO 100 ppm). One VOC, 1,3,5- trimethylbenzene (mesitylene), was detected at concentrations exceeding the PGSCO with a maximum concentration of 120 ppm (PGSCO 8.4 ppm). SVOCs detected sitewide at concentrations exceeding the PGSCOs occurred for two constituents which include benzo(a)anthracene at a maximum concentration of 6.6 ppm (PGSCO 1.0 ppm) and benzo(b)fluoranthene at a maximum concentration of 8.2 ppm (PGSCO 1.7 ppm). Four SVOCs were detected at concentrations exceeding RRSCOs which include: benzo(a)pyrene at a maximum concentration of 6.8 ppm (RRSCO 1.0 ppm), chrysene at a maximum concentration of 6.4 ppm (RRSCO 3.9 ppm), dibenz(a,h)anthracene at a maximum concentration of 1.0 ppm (RRSCO 0.33 ppm), and indeno(1,2,3- cd)pyrene at a maximum concentration of 4.6 ppm (RRSCO 0.5 ppm). One SVOC, benzo(k)fluoranthene was detected in eight samples at a concentration exceeding the UUSCO with a maximum concentration of 2.6 ppm (UUSCO 0.8 ppm). Four pesticides were detected at concentrations exceeding UUSCOs which include: 4,4'-DDD at a maximum concentration of 0.0412 ppm (UUSCO 0.0033 ppm), 4,4'-DDE at a maximum concentration of 0.12 ppm (UUSCO 0.0033 ppm), 4,4'-DDT at a maximum concentration of 1.19ppm (UUSCO 0.0033 ppm), and dieldrin at a maximum concentration of 0.0261 ppm (UUSCO 0.005 ppm). Four metals were detected at concentrations exceeding UUSCOs which include: hexavalent chromium at a maximum concentration of 4.64 ppm (UUSCO 1.0 ppm), trivalent chromium at a maximum concentration of 74.5 ppm (UUSCO 30 ppm), nickel at a maximum concentration of 81.9 ppm (UUSCO 30 ppm), and zinc at a maximum concentration of 2620 ppm (UUSCO 109 ppm). Six metals were detected sitewide at concentrations exceeding RRSCOs include: arsenic which was detected at a maximum concentration of 19.9 ppm (RRSCO 16 ppm), barium with a maximum concentration of 785 ppm (RRSCO 400 ppm), cadmium with a maximum concentration of 7.66 ppm (RRSCO 4.3 ppm), copper with a maximum concentration of 1390 ppm (RRSCO 270 ppm), lead with a maximum concentration of 1660 ppm (RRSCO 400 ppm), and mercury with a maximum concentration of 68 ppm (RRSCO 0.81 ppm), One metal, manganese, was detected at concentrations exceeding the PGSCOs with a maximum concentration of 3290 ppm (PGSCO 2000 ppm). Perfluorooctanesulfonic acid (PFOS) was detected in eight soil sample above UUSCOs and in seven soil samples above PGSCOs with a maximum concentration of 0.00293 parts per billion (ppb) compared

EAST ADAMS REDEVELOPMENT - PHASE II AREA (Continued) **S131764066**

to the PGSCO of 0.001 ppb. Perfluorooctanoic acid (PFOA) was not detected in concentrations exceeding the PGSCO. There were no herbicides detected in soil at concentrations exceeding applicable SCOs. Data does not indicate that there are off-site impacts in soil related to this site. Groundwater: Groundwater sample results were compared to the NYS Ambient Water Quality Standards and Guidance Values (groundwater SCGs). VOCs exceeding applicable groundwater standards, criteria, and guidance (SCGs) occurred in three out of 11 groundwater monitoring wells across the site including 1,2,4,5-tetramethylbenzene at a maximum concentration of 8.9 ppb (SCG 5 ppb) and 1,3,5- trimethylbenzene (mesitylene) at a maximum concentration of 11 ppb (SCG 5 ppb). SVOCs exceeding groundwater SCGs occurred in two out of 11 groundwater monitoring wells across the site including benzo(a)anthracene at a maximum concentration of 0.03 ppb (SCG 0.002 ppb), benzo(b)fluoranthene at a maximum concentration of 0.03 ppb SCG 0.002 ppb), and phenol at a maximum concentration of 2.7 (SCG 1.0 ppb). Five metals in both the dissolved phase and in total exceeded groundwater SCGs throughout the site which include: iron at a maximum concentration of 2,220 ppb (dissolved) and 8,330 ppb (total) (SCG 300 ppb), magnesium at a maximum concentration of 52,400 ppb (dissolved) and 52,600 ppb (total) (SCG 3000 ppb), manganese at a maximum concentration of 13,190 ppb (dissolved) and 13,850 ppb (total) (SCG 300 ppb), selenium at a maximum concentration of 14.4 ppb (dissolved) and 14.6 ppb (total) (SCG 10 ppb), and sodium at a maximum concentration of 208,000 ppb (dissolved) and 220,000 ppb (total) (SCG 20,000 ppb). PFOS was detected in three out of 11 groundwater monitoring wells at concentrations above the applicable groundwater SCG with a maximum detection of 0.0124 ppb (SCG 0.0027 ppb). PFOA and 1,4 Dioxane were not detected in the groundwater monitoring samples above applicable groundwater SCGs. No pesticides, herbicides, or PCBs were detected at concentrations above groundwater SCGs. Data does not indicate that there are off-site impacts in groundwater related to this site. Soil Vapor: Various petroleum VOCs were detected sitewide in the soil vapor samples, most notably hexane at a maximum concentration of 916 micrograms per cubic meter (g/m3). Several chlorinated solvents were detected in the soil vapor samples, most notably tetrachloroethylene at a maximum concentration of 564 g/m3. Data does not indicate any off-site impacts in soil vapor related to this site. "

Water Type: perfluorooctane sulfonic acid

PFAS 3:
Water Type: perfluorooctanoic acid

C32 **THE SALVATION ARMY** **NY UST** **U000415424**
WSW **1105 S. STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.097 mi.
511 ft. **Site 5 of 9 in cluster C**

Relative: UST:
Lower
Actual: Name: THE SALVATION ARMY
399 ft. Address: 1105 S. STATE ST
City,State,Zip: SYRACUSE, NY 13202
Id/Status: 7-128058 / Unregulated/Closed
Program Type: PBS

THE SALVATION ARMY (Continued) **U000415424**

Region: STATE
DEC Region: 7
Expiration Date: N/A
UTM X: 406539.18601
UTM Y: 4765799.29374
Site Type: Other

Affiliation Records:

Site Id: 44653
Affiliation Type: Facility Operator
Company Name: THE SALVATION ARMY
Contact Type: Not reported
Contact Name: THE SALVATION ARMY
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 583-3500
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 44653
Affiliation Type: Facility Owner
Company Name: THE SALVATION ARMY INC.
Contact Type: Not reported
Contact Name: Not reported
Address1: 440 W. NYACK RD.
Address2: Not reported
City: WEST NYACK
State: NY
Zip Code: 10994
Country Code: 001
Phone: (212) 337-4779
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 44653
Affiliation Type: Mail Contact
Company Name: THE SALVATION ARMY INC.
Contact Type: Not reported
Contact Name: Not reported
Address1: 440 W. NYACK RD.
Address2: P.O. BOX C-635
City: W. NYACK
State: NY
Zip Code: 10994-0635
Country Code: 001
Phone: (914) 620-4779
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

THE SALVATION ARMY (Continued) **U000415424**

Site Id:	44653
Affiliation Type:	Emergency Contact
Company Name:	THE SALVATION ARMY INC.
Contact Type:	Not reported
Contact Name:	S. TIMOTHY LANTS, CAPTAIN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 475-9983
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Tank Info:

Tank Number:	001
Tank ID:	128169
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	5000
Install Date:	12/01/1986
Date Tank Closed:	01/01/1998
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B02 - Tank External Protection - Original Sacrificial Anode
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)

C33 **SALVATION ARMY** **UST FINDER RELEASE** **1029076787**
WSW **1105 SOUTH STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 0**
0.097 mi.
511 ft. **Site 6 of 9 in cluster C**

Relative: UST FINDER RELEASE:
Lower

Actual: Object ID:	249484
399 ft. Facility ID:	NY59475
Lust ID:	NY9711143
Name:	SALVATION ARMY
Address:	1105 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1998/01/05 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	2273
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.14737
Y Coord:	43.0391300000001
Latitude:	43.03913
Longitude:	-76.1473699999999

C34 **SPILL NUMBER 8601904** **NY Spills** **S104643869**
WSW **1105 SOUTH STATE ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.097 mi.
511 ft. **Site 7 of 9 in cluster C**

Relative: SPILLS:
Lower

Actual: Name:	SPILL NUMBER 8601904
399 ft. Address:	1105 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8601904 / 1987-08-11
Facility ID:	8601904
Facility Type:	ER
DER Facility ID:	59475
Site ID:	142087
DEC Region:	7

SPILL NUMBER 8601904 (Continued) **S104643869**

Spill Cause:	Human Error
Spill Class:	Not reported
SWIS:	3415
Spill Date:	1986-06-19
Investigator:	UNASSIGNED
Referred To:	Not reported
Reported to Dept:	1986-06-19
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Fire Department
Cleanup Ceased:	1987-08-11
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	Not reported
Latitude:	43.0391313
Longitude:	-76.1473662
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was / / : DEC INVEST. & TOLD F.D. TO USE SORBENT & SAND THE REST.
Remarks:	ON PAVEMENT-55 GAL. DRUM FELL OFF TRUCK-F.D. ON SCENE

All Materials:

Site ID:	142087
Operable Unit ID:	898181
Operable Unit:	01
Material ID:	478370
Material Code:	0028A
Material Name:	ethylene glycol
Case No.:	00107211
Material FA:	Hazardous Material
Quantity:	30.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

C35 **FORMER SALVATION ARMY** **NY LTANKS S102165578**
WSW **1105 SOUTH STATE ST** **NY Spills N/A**
< 1/8 **SYRACUSE, NY**
0.097 mi.
511 ft. **Site 8 of 9 in cluster C**

Relative: LTANKS:
Lower

Name:	FORMER SALVATION ARMY
Address:	1105 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0404882 / 2005-03-04

Actual:
399 ft.

FORMER SALVATION ARMY (Continued) **S102165578**

Facility ID:	0404882
Site ID:	61010
Spill Date:	2004-08-04
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	BFMATTHE
Referred To:	Not reported
Reported to Dept:	2004-08-04
CID:	403
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	2004-08-04
Spill Record Last Update:	2005-03-04
Spiller Name:	DAVID FICKINGER
Spiller Company:	SALVATION ARMY
Spiller Address:	1105 SOUTH STATE ST
Spiller County:	999
Spiller Contact:	DAVID FICKINGER
Spiller Phone:	(315) 475-6181
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	59475
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BM
Remarks:	550 gallon tank.excavation.removing contaminated soil

All Materials:

Site ID:	61010
Operable Unit ID:	888280
Operable Unit:	01
Material ID:	488856
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

SPILLS:

Name:	SALVATION ARMY
Address:	1105 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9711143 / 2002-08-06
Facility ID:	9711143

FORMER SALVATION ARMY (Continued) **S102165578**

Facility Type:	ER
DER Facility ID:	59475
Site ID:	61011
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	1998-01-05
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1998-01-05
CID:	252
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	True
Remediation Phase:	0
Date Entered In Computer:	1998-01-05
Spill Record Last Update:	2002-08-06
Spiller Name:	CAPT MUHS
Spiller Company:	SALVATION ARMY
Spiller Address:	1105 SOUTH STATE ST
Spiller Company:	001
Contact Name:	CAPT MUHS
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM LIMITED INFORMATION, CONTAMINATION MAY EXIST
Remarks:	SOIL CONTAMINATION DISCOVERED UNDER PUMP ISLAND DISPENSER. WILL BE STOCKPILED FOR REMOVAL.

C36 **ROTH BROS METAL CO.** **SEMS-ARCHIVE** **1015754900**
WSW **1107 S. STATE STREET** **LEAD SMELTERS** **NYN000206645**
< 1/8 **SYRACUSE, NY 01320**
0.097 mi.
512 ft. **Site 9 of 9 in cluster C**

Relative: **Lower**

Actual: **399 ft.**

SEMS Archive:

Site ID:	0206645
EPA ID:	NYN000206645
Name:	ROTH BROS METAL CO.
Address:	1107 S. STATE STREET
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Cong District:	Not reported
FIPS Code:	36067
FF:	N
NPL:	Not on the NPL
Non NPL Status:	Referred to Removal - NFRAP

SEMS Archive Detail:

Region:	02
Site ID:	0206645

ROTH BROS METAL CO. (Continued) **1015754900**

EPA ID:	NYN000206645
Site Name:	ROTH BROS METAL CO.
NPL:	N
FF:	N
OU:	00
Action Code:	RS
Action Name:	RV ASSESS
SEQ:	1
Start Date:	2015-08-05 05:00:00
Finish Date:	2015-08-05 05:00:00
Qual:	Not reported
Current Action Lead:	EPA Perf

Region:	02
Site ID:	0206645
EPA ID:	NYN000206645
Site Name:	ROTH BROS METAL CO.
NPL:	N
FF:	N
OU:	00
Action Code:	PA
Action Name:	PA
SEQ:	1
Start Date:	2013-05-10 05:00:00
Finish Date:	2013-06-26 05:00:00
Qual:	N
Current Action Lead:	EPA Perf

Region:	02
Site ID:	0206645
EPA ID:	NYN000206645
Site Name:	ROTH BROS METAL CO.
NPL:	N
FF:	N
OU:	00
Action Code:	HX
Action Name:	PRE-CERC
SEQ:	1
Start Date:	Not reported
Finish Date:	2012-11-28 05:00:00
Qual:	Not reported
Current Action Lead:	EPA Perf

Region:	02
Site ID:	0206645
EPA ID:	NYN000206645
Site Name:	ROTH BROS METAL CO.
NPL:	N
FF:	N
OU:	00
Action Code:	DS
Action Name:	DISCVRY
SEQ:	1
Start Date:	2012-11-28 05:00:00
Finish Date:	2012-11-28 05:00:00
Qual:	Not reported
Current Action Lead:	EPA Perf

ROTH BROS METAL CO. (Continued) **1015754900**

Lead Smelter Sites:

Site ID:	0206645
Facility Region Id:	02
Latitude:	Not reported
Longitude:	Not reported
CoC Ind:	Not reported
Contaminant Name:	Not reported
FF Ind:	N
NAI:	N
Non-Primary Site-Sub Type:	Not reported
NPL:	Not on the NPL
Primary Site-Sub Type:	Batteries/scrap metals/secondary smelting/precious metal recovery (Recycling);
Special Initiative:	Not reported

G37 **DI PINO ANTHONY** **EDR Hist Auto** **1021064592**
WSW **1117 SOUTH STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.099 mi.
524 ft. **Site 1 of 2 in cluster G**

Relative: EDR Hist Auto
Lower

Actual:
399 ft.

Year:	Name:	Type:
1969	DI PINO ANTHONY	Gasoline Service Stations
1969	HALLIDAY HARRY B	General Automotive Repair Shops
1970	HALLIDAY HARRY B	General Automotive Repair Shops
1970	DI PINO ANTHONY	Gasoline Service Stations
1971	HALLIDAY HARRY B	General Automotive Repair Shops
1971	DI PINO ANTHONY	Gasoline Service Stations
1972	DI PINO ANTHONY	Gasoline Service Stations
1972	HALLIDAY HARRY B	General Automotive Repair Shops
1973	HALLIDAY HARRY B	General Automotive Repair Shops
1973	DI PINO ANTHONY	Gasoline Service Stations
1974	HALLIDAY HARRY B	General Automotive Repair Shops
1974	DI PINO ANTHONY	Gasoline Service Stations
1975	HALLIDAY HARRY B	General Automotive Repair Shops
1975	DI PINO ANTHONY	Gasoline Service Stations
1976	HALLIDAY HARRY B	General Automotive Repair Shops
1976	DI PINO ANTHONY	Gasoline Service Stations
1977	HALLIDAY HARRY B	General Automotive Repair Shops
1977	DI PINO ANTHONY	Gasoline Service Stations

G38 **FORMER SALVATION ARMY PROPERTY** **NY UST** **U004046802**
WSW **1117 SOUTH STATE ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.099 mi.
524 ft. **Site 2 of 2 in cluster G**

Relative: UST:
Lower

Actual:
399 ft.

Name:	FORMER SALVATION ARMY PROPERTY
Address:	1117 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-601001 / Unregulated/Closed
Program Type:	PBS
Region:	STATE

FORMER SALVATION ARMY PROPERTY (Continued) **U004046802**

DEC Region: 7
Expiration Date: N/A
UTM X: 406603.83375
UTM Y: 4765746.98664
Site Type: Other

Affiliation Records:

Site Id: 333717
Affiliation Type: Mail Contact
Company Name: SYRACUSE HOUSING AUTHORITY
Contact Type: Not reported
Contact Name: DAVID FICKENSHER
Address1: 516 BURT ST.
Address2: Not reported
City: SYRACUSE
State: NY
Zip Code: 13202
Country Code: 001
Phone: (315) 475-6181
EMail: Not reported
Fax Number: Not reported
Modified By: DJLASALL
Date Last Modified: 2004-11-17

Site Id: 333717
Affiliation Type: Facility Operator
Company Name: FORMER SALVATION ARMY PROPERTY
Contact Type: Not reported
Contact Name: N\\A
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (315) 475-6181
EMail: Not reported
Fax Number: Not reported
Modified By: DJLASALL
Date Last Modified: 2004-11-17

Site Id: 333717
Affiliation Type: Emergency Contact
Company Name: SYRACUSE HOUSING AUTHORITY
Contact Type: Not reported
Contact Name: N\\A
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (315) 475-6181
EMail: Not reported
Fax Number: Not reported
Modified By: DJLASALL
Date Last Modified: 2004-11-17

FORMER SALVATION ARMY PROPERTY (Continued) **U004046802**

Site Id:	333717
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	516 BURT ST.
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 475-6181
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DJLASALL
Date Last Modified:	2004-11-17

Tank Info:

Tank Number:	001
Tank ID:	180870
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	1000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0000
Common Name of Substance:	Empty
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

L00 - Piping Leak Detection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
I00 - Overfill - None
K00 - Spill Prevention - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
J00 - Dispenser - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None

Tank Number:	002
Tank ID:	180871
Tank Status:	Closed - Removed

FORMER SALVATION ARMY PROPERTY (Continued) **U004046802**

Material Name: Closed - Removed
Capacity Gallons: 1000
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
L00 - Piping Leak Detection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
K00 - Spill Prevention - None
J00 - Dispenser - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None

Tank Number: 003
Tank ID: 180872
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 1000
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

G00 - Tank Secondary Containment - None
L00 - Piping Leak Detection - None
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None

FORMER SALVATION ARMY PROPERTY (Continued) **U004046802**

K00 - Spill Prevention - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
E00 - Piping Secondary Containment - None
J00 - Dispenser - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None

Tank Number:	004
Tank ID:	180873
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	1000
Install Date:	Not reported
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0000
Common Name of Substance:	Empty
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

L00 - Piping Leak Detection - None
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
K00 - Spill Prevention - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
E00 - Piping Secondary Containment - None
J00 - Dispenser - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None

H39 **CENTRAL VILLAGE HOUSING PROJECT** **UST FINDER** **1028590168**
SW **302 BURT ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.104 mi.
551 ft. **Site 1 of 3 in cluster H**

Relative: UST FINDER:
Lower

Actual: Object ID:	318193
396 ft. Facility ID:	NY46337
Name:	CENTRAL VILLAGE HOUSING PROJECT
Address:	302 BURT ST
City,State,Zip:	SYRACUSE, NY 13202
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	0

CENTRAL VILLAGE HOUSING PROJECT (Continued) **1028590168**

TOS USTs:	1
Population 1500ft:	2207
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Open UST(s)
Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.147216
Y Coord:	43.03821
Latitude:	43.03821
Longitude:	-76.147216

UST FINDER:

Object ID:	1282797
Facility ID:	NY46337
Tank ID:	NY74450
Tank Status:	Temporarily out of Service
Installation Date:	1984/12/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	10000
Substances:	Not reported
Tank Wall Type:	Not reported

H40 **CENTRAL VILLAGE HOUSING PROJECT** **NY UST** **U000388734**
SW **302 BURT ST** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.104 mi.
551 ft. **Site 2 of 3 in cluster H**

Relative: **Lower**
Actual: **396 ft.**

UST:

Name:	CENTRAL VILLAGE HOUSING PROJECT
Address:	302 BURT ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-498955 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	02/10/2030
UTM X:	406652.97099
UTM Y:	4765681.72010
Site Type:	Apartment Building/Office Building

Affiliation Records:

Site Id:	46337
Affiliation Type:	Facility Operator

CENTRAL VILLAGE HOUSING PROJECT (Continued) **U000388734**

Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	SYRACUSE HOUSING AUTHORITY
Address1:	516 Burt Street
Address2:	Not reported
City:	Syracuse
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 475-6181
EMail:	mliquori@syrhousing.org
Fax Number:	Not reported
Modified By:	nFormUpd
Date Last Modified:	2024-12-13

Site Id:	46337
Affiliation Type:	Mail Contact
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	Director of Asset Management and Modernization
Contact Name:	Melissa Liquori
Address1:	516 BURT ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 470-4354
EMail:	mliquori@SYRHOUSING.ORG
Fax Number:	Not reported
Modified By:	nFormUpd
Date Last Modified:	2024-12-13

Site Id:	46337
Affiliation Type:	Emergency Contact
Company Name:	Melissa Liquori
Contact Type:	Not reported
Contact Name:	Melissa Liquori
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NY
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 956-2644
EMail:	Not reported
Fax Number:	Not reported
Modified By:	nFormUpd
Date Last Modified:	2024-12-13

Site Id:	46337
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	FACILITIES MANAGER
Contact Name:	MARTIN BRUNET
Address1:	516 BURT ST
Address2:	Not reported
City:	SYRACUSE

CENTRAL VILLAGE HOUSING PROJECT (Continued) **U000388734**

State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 470-4354
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2019-12-10

Tank Info:

Tank Number:	001
Tank ID:	133571
Tank Status:	Temporarily Out of Service
Material Name:	Temporarily Out of Service
Capacity Gallons:	10000
Install Date:	12/01/1984
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Fiberglass coated steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	34
Date Test:	07/26/2019
Next Test Date:	07/26/2020
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

C02 - Pipe Location - Underground/On-ground
A00 - Tank Internal Protection - None
B04 - Tank External Protection - Fiberglass
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
K00 - Spill Prevention - None
L09 - Piping Leak Detection - Exempt Suction Piping
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None

F41 **SU STEAM STATION** **NY Spills** **S102166608**
ESE **550 E TAYLOR ST** **N/A**
< 1/8 **SYRACUSE, NY**
0.105 mi.
553 ft. **Site 2 of 5 in cluster F**

Relative:
Higher

Actual:
409 ft.

SPILLS:

Name:	SU STEAM STATION
Address:	550 E TAYLOR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8912216 / 1990-04-04
Facility ID:	8912216
Facility Type:	ER

SU STEAM STATION (Continued) **S102166608**

DER Facility ID:	115025
Site ID:	133848
DEC Region:	7
Spill Cause:	Human Error
Spill Class:	Not reported
SWIS:	3415
Spill Date:	1990-03-23
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1990-03-23
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	1990-03-27
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1990-04-02
Spill Record Last Update:	1990-04-04
Spiller Name:	Not reported
Spiller Company:	INTERFACESVC
Spiller Address:	5834 BUTTERNUT AVE.
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0394536
Longitude:	-76.1430509
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 04/04/90: MOST OF THE OIL WAS CONTAINED IN SECONDARY CONTAINMENT PIPE. SOIL WHICH WAS CONTAMINATED WAS STAGED AND EVENTUALLY REMOVED FROM THE SITE.
Remarks:	BACKHOE BROKE RETURN LINE OF A NEW 4-TANK INSTALLATION.

All Materials:

Site ID:	133848
Operable Unit ID:	937929
Operable Unit:	01
Material ID:	441689
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	5.00
Resource Affected:	Soil
Oxygenate:	Not reported

H42 **EAST ADAMS REDEVELOPMENT - ALMUS OLVER TOWER** **NY BROWNFIELDS** **S131541419**
SW **300 BURT STREET** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.105 mi.
554 ft. **Site 3 of 3 in cluster H**

Relative:
Lower

Actual:
396 ft.

BROWNFIELDS:

Name:	EAST ADAMS REDEVELOPMENT - ALMUS OLVER TOWER
Address:	300 BURT STREET
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	657340
Acres:	2.306
HW Code:	C734161
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	09/22/2023
Record Updated Date:	02/14/2024
Update By:	GWPRISCO
Site Description:	"02/13/2024 Site was denied from the Brownfield Cleanup Program (BCP). Based upon review of the BCP application, the proposed site is not a brownfield site as defined in Article 27, Title 14 of the Environmental Conservation Law. Location: The site is located at 300 Burt Street within an urban, mixed-use area in the City of Syracuse, New York. The site is located in the northwestern portion of an about 8.82-acre tax parcel, identified as Onondaga County Tax Parcel 094.-17-01.0. The site is bound by a residential building at 302 Burt Street and Burt Street followed by vacant land at 516 Burt Street to the north, Oakwood Avenue followed by residential and commercial properties at 221-223 Oakwood Avenue and 233-235 Oakwood Avenue, respectively, and vacant land at 229 Oakwood Avenue to the east, residential buildings at 313 Raynor Avenue East and Oakwood Avenue to the south, and vacant land at 234-238 Burt Street and State Street South and 1208, 1210, 1212, 1214, 1216, 1218-1220, and 1224 State Street South to the west. The site is improved with a 12-story apartment building in the central part of the site and asphalt-paved parking lots surrounding the building to the northeast, south, and west. The remainder of the site is comprised of landscaped areas and concrete-paved walkways. The area surrounding the site consists of residential, commercial, and industrial properties. Site Features: According to the May 2023 Phase I Environmental Site Assessment (ESA) and the July 2023 Phase II ESA prepared by EA engineering, P.C. and its affiliate EA Science and Technology (EA), the elevation of the site ranges from about elevation (el) 388 to 398 feet. The topography of the site is generally flat with the surrounding area gently sloping towards the southwest. Current Zoning and Land Use: According to the Rezone Syracuse ordinance and City of Syracuse Zoning Map, the site is located within an MX-4: Urban Core District. The MX-4: Urban Core zoning district is generally characterized as pedestrian-friendly, transit-supportive areas of higher density residential development and a well-integrated mix of non-residential uses. The surrounding properties are zoned for MX-2: Neighborhood Center Districts, R2: Low Density Residential Districts, R4: Medium Density Residential Districts, and R5: High Density Residential Districts. Land use within a half-mile radius is urban and includes residential, commercial, institutional/public services, industrial, vacant land, and public parks. The nearest ecological receptor is the Onondaga Creek, located approximately 0.4 miles west of the site. At present, the site is occupied by a residential building,

EAST ADAMS REDEVELOPMENT - ALMUS OLVER TOWER (Continued) **S131541419**

asphalt-paved parking lots, landscaped areas and concrete-paved walkways. Past Use of the Site: Historical Sanborn Fire Insurance Maps indicate that the site has been located in a residential and commercial area since as early as 1892. By 1892, the site was developed with several one- to two-story dwellings, stables, sheds, and store fronts. By 1910, some of the structures were demolished. From 1951 to 1961, the site was developed with an automobile repair facility in the northwestern part of the site and a printing, paper ruling and book binding facility and a beer warehouse in the southern part of the site. The remainder of the site was developed with residential and commercial buildings, with automobile garages identified in the eastern part of the site. By 1963, the site was occupied by the Syracuse Housing Authority and developed in its present-day configuration. Site Geology and Hydrogeology: According to the U.S. Department of Agriculture s (USDA) Natural Resources Conservation Service (NRCS) Soil Survey Geographic (SSURGO) data for the site, soils at the site are comprised primarily of urban land. Urban land is described as excavated, filled, and made land. According to the Phase II ESA conducted by EA, soil at the site consists of brown silty sand with varying amounts of medium-grained sand, gravel, and clay to about 6 feet below ground surface (bgs). This layer is underlain by brown to gray clay with varying amounts of silt, fine- to medium-grained sand, gravel, and organic matter to the termination depth of the borings (about 15 feet bgs). Bedrock was not encountered during the investigation. Based on review of the Geologic Map of New York, Finger Lakes Sheet (Fisher, Isachsen, Rickard, dated March 1970) , the site is underlain by bedrock of the Syracuse Foundation, consisting of dolostone, shale, gypsum and salt. Based on measurements collected during the Phase II ESA conducted by EA, groundwater at the site flows to the southwest, following the local topography, towards Onondaga Creek. Groundwater was observed at about 6.4 to 9.0 feet bgs (corresponding to el. 382.47 to 383.94). "

Env Problem:	"Information submitted with the BCP application regarding the environmental condition at the site are currently under review and will be revised as additional information becomes available."
Health Problem:	"Information submitted with the BCP application regarding the conditions at the site are currently under review and will be revised as additional information becomes available."
Dump:	Not reported
Structure:	Not reported
Lagoon:	Not reported
Landfill:	Not reported
Pond:	Not reported
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	Not reported
Record Upd:	Not reported
Updated By:	Not reported
Own Op:	4
Sub Type:	NNN
Owner Name:	William J Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202

EAST ADAMS REDEVELOPMENT - ALMUS OLVER TOWER (Continued) **S131541419**

Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Rene Battelle
Owner Company:	Onondaga County Public Libraries-Central Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Allyson Carpenter
Owner Company:	Almus Olver Tower, L.P.
Owner Address:	28 Liberty Street
Owner Addr2:	Not reported
Owner City,St,Zip:	New York, NY 10005
Owner Country:	United States of America
Own Op:	1
Sub Type:	NNN
Owner Name:	William J Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	Not reported
Cross Ref Type Code:	Not reported
Cross Ref Type:	Not reported
Record Added Date:	Not reported
Record Updated:	Not reported
Updated By:	Not reported

F43 **NYSDOT BIN 1031569** **RCRA NonGen / NLR** **1000889982**
East **I-81/EAST ADAMS STREET** **NY MANIFEST** **NY0000202481**
< 1/8 **SYRACUSE, NY 13202**
0.106 mi.
558 ft. **Site 3 of 5 in cluster F**

Relative: **Higher**

Actual: **409 ft.**

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	Nysdot Bin 1031569
Handler Address:	I-81/East Adams Street
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NY0000202481
Contact Name:	RICHARD S STEELE
Contact Address:	SOUTH WARREN STREET
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-448-7363
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified

NYSDOT BIN 1031569 (Continued) **1000889982**

Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Ny
State District:		NYSDEC R7
Mailing Address:		SOUTH WARREN STREET
Mailing City,State,Zip:		SYRACUSE, NY 13202
Owner Name:	Nysdot	
Owner Type:		State
Operator Name:	Nysdot	
Operator Type:		State
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
202 GPRA Corrective Action Baseline:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No
Addressed Significant Non-Complier Universe:		No
Significant Non-Complier With a Compliance Schedule Universe:		No
Financial Assurance Required:		Not reported
Handler Date of Last Change:		20150414
Recognized Trader-Importer:		No
Recognized Trader-Exporter:		No
Importer of Spent Lead Acid Batteries:		No
Exporter of Spent Lead Acid Batteries:		No
Recycler Activity Without Storage:		No
Manifest Broker:		No
Sub-Part P Indicator:		No

Biennial: List of Years

Year:	2001

NYSDOT BIN 1031569 (Continued) **1000889982**

Click Here for Biennial Reporting System Data:

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	D008
Waste Description:	Lead
Waste Code:	NONE
Waste Description:	Not Defined

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: NYSDOT	
Legal Status:	State
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	109 S WARREN ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-448-7342
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: NYSDOT	
Legal Status:	State
Date Became Current:	20010101
Date Ended Current:	Not reported
Owner/Operator Address:	109 S WARREN ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-448-7342
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name: NYSDOT	
Legal Status:	State
Date Became Current:	20010101
Date Ended Current:	Not reported
Owner/Operator Address:	109 S WARREN ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-448-7342
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	19950227
Handler Name: NYSDOT BIN 1031569	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No

NYSDOT BIN 1031569 (Continued) **1000889982**

Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20060101
Handler Name: NYSDOT BIN 1031569	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20070101
Handler Name: NYSDOT BIN 1031569	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	19940411
Handler Name: NYSDOT BIN 1031569	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20010521
Handler Name: NYSDOT BIN 1031569	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No

NYSDOT BIN 1031569 (Continued) **1000889982**

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20020227
Handler Name: NYSDOT BIN 1031569
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 23412
NAICS Description: Bridge And Tunnel Construction

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

NY MANIFEST:
EPA ID: NY0000202481
Country: USA
Name: New York State Dept Of Transportation
Address: RTE I-81 OVER E ADAMS ST
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported
Location Address 1: UNDER I-81 ADAM ST
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: New York State Dept Of Transportation
Mailing Contact: Daniel F Weaver
Mailing Address 1: 3522 JAMES ST SUITE 206
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13206
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154379886

Manifest Data:
Document ID: NYG1987011

NYSDOT BIN 1031569 (Continued) **1000889982**

Manifest Status:	Not reported
Trans1 State ID:	AB32265
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	07/19/2001
Trans1 Recv Date:	07/19/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/20/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000202481
Trans1 EPA ID:	NYD986903904
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Lead
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	12500
Units:	Pounds
Number of Containers:	025
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJR986628162
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	11/05/2015
Trans1 Recv Date:	11/05/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/05/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000202481
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD991291105
TSDF ID 2:	Not reported
Manifest Tracking Number:	008273657FLE

NYSDOT BIN 1031569 (Continued) **1000889982**

Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code a:	Lead
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	500
Units:	Pounds
Number of Containers:	2
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	1

Document ID:	NYG3113442
Manifest Status:	Not reported
Trans1 State ID:	AB32265NY
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	10/03/2001
Trans1 Recv Date:	10/03/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/08/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000202481
Trans1 EPA ID:	NYD986903904
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported

NYSDOT BIN 1031569 (Continued) **1000889982**

MGMT Method Type Code: Not reported
Waste Code 1: Lead
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 32000
Units: Pounds
Number of Containers: 040
Container Type: Metal drums, barrels, kegs
Handling Method: Treat
Specific Gravity: 01.00

Document ID: NYB6578505
Manifest Status: Not reported
Trans1 State ID: Not reported
Year: 1994
Trans2 State ID: Not reported
Generator Ship Date: 11/01/1994
Trans1 Recv Date: 11/01/1994
Trans2 Recv Date: Not reported
TSD Site Recv Date: 11/04/1994
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NY0000202481
Trans1 EPA ID: NYD980769947
Trans2 EPA ID: Not reported
TSDF ID 1: OHD066060609
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: Lead
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 02500
Units: Pounds
Number of Containers: 005
Container Type: Metal drums, barrels, kegs
Handling Method: Treat
Specific Gravity: 01.00

I44
West
< 1/8
0.107 mi.
564 ft.

S STATE STREET
S STATE ST/NEW STREET
SYRACUSE, NY

Site 1 of 3 in cluster I

NY LTANKS **S100494186**
N/A

Relative:
Lower

Actual:
398 ft.

LTANKS:

Name:	S STATE STREET
Address:	S STATE ST/NEW STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9208359 / 1993-01-26
Facility ID:	9208359
Site ID:	229077
Spill Date:	1992-10-19
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C4
Cleanup Ceased:	1993-01-26
SWIS:	3415
Investigator:	MENASH
Referred To:	Not reported
Reported to Dept:	1992-10-20
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1992-10-20
Spill Record Last Update:	1993-01-27
Spiller Name:	Not reported
Spiller Company:	SYRACUSE HOUSING AUTH
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	188876
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MN
Remarks:	UNCOVERED 550 GAL TANK WHILE EXCAVATING FOR SEWER LINE. CONTAMINATED SOIL FOUND FROM LEAKING TANK. SOIL TO BE STAGED AND DISPOSED OF BY SYR HOUSING AUTH

All Materials:

Site ID:	229077
Operable Unit ID:	971954
Operable Unit:	01
Material ID:	408947
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00

S STATE STREET (Continued) **S100494186**

Resource Affected: Soil
Oxygenate: Not reported

45
SE
< 1/8
0.112 mi.
592 ft.

SYRACUSE HOUSING AUTHORITY
516 BURT ST
SYRACUSE, NY 13202

RCRA NonGen / NLR **1004570531**
FINDS **NYD981873599**
ECHO
NY MANIFEST

Relative:
Higher

Actual:
410 ft.

RCRA Listings:

Date Form Received by Agency:		20070101
Handler Name:		Syracuse Housing Authority
Handler Address:		Burt St
Handler City,State,Zip:		SYRACUSE, NY 13202
EPA ID:		NYD981873599
Contact Name:		EILEEN D GILLIGAN
Contact Address:		BURT ST
Contact City,State,Zip:		SYRACUSE, NY 13202
Contact Telephone:		315-475-6181
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		02
Land Type:		Not reported
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Ny
State District:		NYSDEC R7
Mailing Address:		BURT ST
Mailing City,State,Zip:		SYRACUSE, NY 13202
Owner Name:	Syracuse Housing Authority	
Owner Type:		Municipal
Operator Name:	Syracuse Housing Authority	
Operator Type:		Municipal
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
202 GPRA Corrective Action Baseline:		No

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Biennial: List of Years
Year: 2001

Click Here for Biennial Reporting System Data:

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	D008
Waste Description:	Lead
Waste Code:	NONE
Waste Description:	Not Defined
Waste Code:	X002
Waste Description:	Not Defined

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	SYRACUSE HOUSING AUTHORITY
Legal Status:	Municipal
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	516 BURT ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-475-6181
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	SYRACUSE HOUSING AUTHORITY
Legal Status:	Municipal
Date Became Current:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Date Ended Current: Not reported
Owner/Operator Address: 516 BURT ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-475-6181
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 516 BURT ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-475-6181
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 19950519
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Not reported
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19961125
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19980227
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20020618
Handler Name: SYRACUSE HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 53111
NAICS Description: Lessors Of Residential Buildings And Dwellings

NAICS Code: 92511
NAICS Description: Administration Of Housing Programs

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

FINDS:
Registry ID: 110000809457

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
All generators and treatment, storage, and disposal (TSD) facilities who handle hazardous waste are required to report to the EPA Administrator at least once every two years. The data collected is used to create the National Biennial Resource Conservation and Recovery Act (RCRA) Hazardous Waste Report. This data is processed within the RCRA Information (RCRAInfo) database
The Integrated Compliance Information System (ICIS) provides a database that, when complete, will contain integrated enforcement and compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions and a subset of the Permit Compliance System (PCS), which supports the National Pollutant Discharge Elimination System (NPDES). This information is maintained in ICIS by EPA in the Regional offices and it at Headquarters. A future release of ICIS will completely replace PCS and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities that support compliance and enforcement programs, including incident tracking, compliance assistance, and compliance monitoring.
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1004570531
Registry ID: 110000809457

DFR URL:
Name: SYRACUSE HOUSING AUTHORITY
Address: 516 BURT ST
City,State,Zip: SYRACUSE, NY 13202

NY MANIFEST:
EPA ID: NYD981873599
Country: USA
Name: Syracuse Housing Authority
Address: 516 BURT ST
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported
Location Address 1: 300 BURT STREET
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: Syracuse Housing Authority
Mailing Contact: Cary Barber
Mailing Address 1: 516 BURT STREET
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3156474221

Manifest Data:
Document ID: NHG0004600
Manifest Status: Not reported
Trans1 State ID: PR5398NY
Year: 2002
Trans2 State ID: Not reported
Generator Ship Date: 01/10/2002
Trans1 Recv Date: 01/10/2002
Trans2 Recv Date: Not reported
TSD Site Recv Date: 01/14/2002
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD981873599
Trans1 EPA ID: NYD980761191
Trans2 EPA ID: Not reported
TSDF ID 1: NHD018902874
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: B001
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00003
Units: Kilograms
Number of Containers: 002
Container Type: Metal drums, barrels, kegs
Handling Method: Treat
Specific Gravity: 01.00

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Document ID:	NYB7405668
Manifest Status:	Not reported
Trans1 State ID:	NY2281OH
Year:	1995
Trans2 State ID:	Not reported
Generator Ship Date:	12/05/1995
Trans1 Recv Date:	12/05/1995
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/06/1995
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981873599
Trans1 EPA ID:	NYD982792814
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Lead
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00150
Units:	Pounds
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Waste Code 7:	Lead
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00375
Units:	Pounds
Number of Containers:	005
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	01.00

Document ID:	MAG0910650
Manifest Status:	Not reported
Trans1 State ID:	TNY34284
Year:	1996
Trans2 State ID:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Generator Ship Date:	12/20/1996
Trans1 Recv Date:	12/20/1996
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/30/1996
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981873599
Trans1 EPA ID:	MAD019371079
Trans2 EPA ID:	Not reported
TSDF ID 1:	MAD019371079
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Cadmium
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00055
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	01.00

Document ID:	NYB8711514
Manifest Status:	Not reported
Trans1 State ID:	67285KNY
Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	01/23/1997
Trans1 Recv Date:	01/23/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/24/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981873599
Trans1 EPA ID:	NYD000688671
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B007
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	14941
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYB8711523
Manifest Status:	Not reported
Trans1 State ID:	8375577NY
Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	01/24/1997
Trans1 Recv Date:	01/24/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/28/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981873599
Trans1 EPA ID:	NYD046765574
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B001
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	04800
Units:	Kilograms
Number of Containers:	004

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	B006
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00800
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG1960578
Manifest Status:	Not reported
Trans1 State ID:	NPF236KS
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	07/09/2001
Trans1 Recv Date:	07/09/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/09/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981873599
Trans1 EPA ID:	SCR000074591
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD981113749
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B002
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	02455
Units:	Kilograms
Number of Containers:	002
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	B003
Waste Code 8:	Not reported

SYRACUSE HOUSING AUTHORITY (Continued) **1004570531**

Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	01245
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Recycle
Specific Gravity:	01.00

F46 **SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE** **RCRA-SQG** **1010566799**
ESE **1207 ALMOND ST** **E MANIFEST** **NYR000154468**
< 1/8 **SYRACUSE, NY 13202** **NY MANIFEST**
0.114 mi.
603 ft. **Site 4 of 5 in cluster F**

Relative: **Higher**
Actual: **410 ft.**

RCRA Listings:

Date Form Received by Agency:		20080205
Handler Name:		Syracuse Housing Auth - Toomey Aggo Towe
Handler Address:		Almond St
Handler City,State,Zip:		SYRACUSE, NY 13202
EPA ID:		NYR000154468
Contact Name:		WILLIAM W GEHRKE
Contact Address:		BURT ST
Contact City,State,Zip:		SYRACUSE, NY 13202
Contact Telephone:		315-470-4315
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		02
Land Type:		Other
Federal Waste Generator Description:		Small Quantity Generator
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Handler Activities
State District Owner:		Ny
State District:		NYSDEC R7
Mailing Address:		ALMOND ST
Mailing City,State,Zip:		SYRACUSE, NY 13202
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No

SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE (Continued) **1010566799**

Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D002
Waste Description:	Corrosive Waste

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name: SYRACUSE HOUSING AUTH	
Legal Status:	Other
Date Became Current:	19690101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: SYRACUSE HOUSING AUTH	
Legal Status:	Other
Date Became Current:	19690101
Date Ended Current:	Not reported
Owner/Operator Address:	516 BURT ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported

SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE (Continued) **1010566799**

Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20080205
Handler Name: SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080206
Handler Name: SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWER
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 92511
NAICS Description: Administration Of Housing Programs

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

E MANIFEST:
Manifest Tracking Number: 011099030FLE
Last Updated Date: 20190225
Shipped Date: 20181128
Received Date: 20181206
Manifest Status: Corrected
Submission Type: DataImage5Copy
Origin Type: Service
Generator EPA ID: NYR000154468
Generator Name: Syracuse Housing Auth - Toomey Aggo Towe
Generator Location Street Number: Not reported
Generator Location Street 1: 1207 ALMOND ST
Generator Location Street 2: Not reported
Generator Location City: SYRACUSE
Generator Location State: NY

SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE (Continued) **1010566799**

Generator Location Zip:	13202
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	1207 ALMOND ST
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13202
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	VTR000517052
Designated Facility Name:	Enpro Services Of Vermont, Inc.
Designated Facility Mail Street Number:	54
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	54 AVENUE D
Designated Facility Mail City:	WILLISTON
Designated Facility Mail Zip:	05495
Designated Facility Mail State:	VT
Designated Facility Location Street Number:	54
Designated Facility Location Street 1:	54 AVENUE D
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	WILLISTON
Designated Facility Location Zip:	05495
Designated Facility Location State:	VT
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	006546910GBF
Last Updated Date:	20210920
Shipped Date:	20210813
Received Date:	20210910
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYR000154468
Generator Name:	Syracuse Housing Authority
Generator Location Street Number:	Not reported
Generator Location Street 1:	1207 ALMOND ST
Generator Location Street 2:	Not reported
Generator Location City:	SYACUSE
Generator Location State:	NY
Generator Location Zip:	13210
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	516 BURT ST
Generator Mail Street 2:	Not reported
Generator Mail City:	SYACUSE
Generator Mail Zip:	13202
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	MID048090633
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	49350 N I-94 SERVICE DRIVE
Designated Facility Mail City:	BELLEVILLE
Designated Facility Mail Zip:	48111
Designated Facility Mail State:	MI
Designated Facility Location Street Number:	Not reported

SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE (Continued) **1010566799**

Designated Facility Location Street 1: 49350 N I-94 SERVICE DRIVE
Designated Facility Location Street 2: Not reported
Designated Facility Location City: BELLEVILLE
Designated Facility Location Zip: 48111
Designated Facility Location State: MI
Designated Facility Contact Company Name: Wayne Disposal, Inc. Site #2 Landfill
Manifest Residue Indicator: N
Rejection Indicator: N

PCB Information:
Manifest Tracking Number: 006546910GBF
Waste Line Number: 1
Article or Container ID: 1
Bulk Identity: Not reported
Date of Removal: 20210813
Load Type: ArticleInContainer
Load Type Description: Article in Container
Waste Type: PCB Solid
Weight: 50

Manifest Tracking Number: 006546910GBF
Waste Line Number: 1
Article or Container ID: 3
Bulk Identity: Not reported
Date of Removal: 20210813
Load Type: ArticleInContainer
Load Type Description: Article in Container
Waste Type: PCB Solid
Weight: 50

Manifest Tracking Number: 006546910GBF
Waste Line Number: 1
Article or Container ID: 2
Bulk Identity: Not reported
Date of Removal: 20210813
Load Type: ArticleInContainer
Load Type Description: Article in Container
Waste Type: PCB Solid
Weight: 50

Transporter:
Manifest Tracking Number: 006546910GBF
Transporter Line Number: 1
Transporter EPA ID: MAC300098399
Transporter Name: Nrc East Environmental Services, Inc.

Manifest Tracking Number: 006546910GBF
Transporter Line Number: 2
Transporter EPA ID: MAD084814136
Transporter Name: Eq Northeast, Inc.

Manifest Tracking Number: 006546910GBF
Transporter Line Number: 3
Transporter EPA ID: MIK593743838
Transporter Name: Us Ecology Transportation Solutions, Inc

SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE (Continued) **1010566799**

Waste Line:

Manifest Tracking Number:	006546910GBF
Waste Line Number:	1
U.S. DOT Hazardous Indicator:	Y
U.S. DOT ID Number:	UN3432
U.S. DOT Description:	Rq, Un3432, Polychlorinated Biphenyls, Solid, 9, Pgii, Pcb Asbestos, Erg#171
Non-Hazardous Waste Description:	Not reported
Number of Containers:	3
Container Type Code:	CF
Container Type Description:	Fiber or plastic boxes, cartons, cases
Waste Quantity:	150
Quantity Unit of Measure Code:	K
Quantity Unit of Measure Description:	Kilograms
Waste Quantity, in Tons:	0.1653749
Acute Waste Quantity, in Tons:	0
Non-Acute Waste Quantity, in Tons:	0.1653749
Waste Quantity, in Kilograms:	150
Acute Waste Quantity, in Kilograms:	0
Non-Acute Waste Quantity, in Kilorgrams:	150
Management Method Code:	H132
Management Method Description:	LANDFILL (WITH PRIOR TREATMENT AND/OR STABILIZATION)
Waste Residue Indicator:	N
Quantity Discrepancy Indicator:	N
Waste Type Discrepancy Indicator:	N
Waste Density:	Not reported
Waste Density Unit of Measure Code:	Not reported
Waste Density Unit of Measure Description:	Not reported
Form Code:	Not reported
Form Code Description:	Not reported
Source Code:	Not reported
Source Code Description:	Not reported
Waste Minimization Code:	Not reported
Waste Minimization Code Description:	Not reported
Consent Number:	Not reported
EPA Waste Indicator:	N
Federal Waste Codes:	Not reported
Quantity Haz Kg:	0
Quantity Haz Tons:	0
Quantity Non Haz Kg:	150
Quantity Non Haz Tons:	0.1653749
State Waste Codes:	NY-B007

NY MANIFEST:

EPA ID:	NYR000154468
Country:	USA
Name:	Syracuse Housing Auth - Toomey Aggo Tower
Address:	1207 ALMOND ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	1207 ALMOND ST
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported

SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE (Continued) **1010566799**

Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: Syracuse Housing Auth - Toomey Aggo Tower
Mailing Contact: William Gehrke
Mailing Address 1: 516 BURT ST
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154704315

Manifest Data:
Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NYR000115733
Year: 2018
Trans2 State ID: NYD980761191
Generator Ship Date: 03/12/2008
Trans1 Recv Date: 03/12/2008
Trans2 Recv Date: 03/21/2008
TSD Site Recv Date: 03/25/2008
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000154468
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: PAD067098822
TSDF ID 2: Not reported
Manifest Tracking Number: 000885781FLE
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H141
Waste Code a: Corrosive Waste
Waste Code b: Not reported
Waste Code c: Not reported
Waste Code e: Not reported
Waste Code f: Not reported
Waste Code g: Not reported
Waste Code 1: Not reported
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 55
Units: Gallons (liquids only)
Number of Containers: 1

SYRACUSE HOUSING AUTH - TOOMEY AGGO TOWE (Continued) **1010566799**

Container Type: Fiberboard or plastic drums, barrels, kegs
Handling Method: Landfill
Specific Gravity: 1

F47 **SYRACUSE HOUSING AUTHORITY TOOMEY AGGO TOWER** **PA MANIFEST** **S110049554**
ESE **1207 ALMOND STREET** **N/A**
< 1/8 **SYRACUSE, NY 13202**
0.114 mi.
603 ft. **Site 5 of 5 in cluster F**

Relative: **Higher**
Actual: **410 ft.**

PA MANIFEST:

Name:	SYRACUSE HOUSING AUTHORITY TOOMEY AGGO TOWER
Address:	1207 ALMOND STREET
City,State,Zip:	SYRACUSE, NY 13202
Year:	2008
Manifest Number:	000885781FLE
Manifest Type:	T
Generator EPA ID:	NYR000154468
Generator Date:	03/12/2008
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-470-4315
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D002
Container Number:	1
Container Type:	DF
Waste Quantity:	55
Unit:	G
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

---

48 **NIAGARA MOHAWK POWER CORP** **NY LTANKS** **S108294880**
SSW **235 OAKWOOD AVE. EXT.** **NY Spills** **N/A**
1/8-1/4 **TROY, NY 13202** **NY MANIFEST**
0.131 mi.
693 ft.

Relative: **Lower**
Actual: **398 ft.**

LTANKS:

Name:	NIMO OAKWOOD AVE RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	9409889 / 1995-04-18
Facility ID:	9409889
Site ID:	327666
Spill Date:	1994-10-24
Spill Cause:	Tank Test Failure

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Spill Source:	Commercial/Industrial
Spill Class:	B3
Cleanup Ceased:	1995-02-28
SWIS:	4217
Investigator:	WXOBRIEN
Referred To:	Not reported
Reported to Dept:	1994-10-24
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1994-11-03
Spill Record Last Update:	2012-07-18
Spiller Name:	Not reported
Spiller Company:	NIAGARA MOHAWK NIMO
Spiller Address:	Not reported
Spiller County:	999
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	4
DER Facility ID:	263775
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was O'BRIEN Tank pit contaminated from leakage. not leaving area. Will have to remediate when tanks are replaced. PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374. 4/28/06 GW results from 1995 show low levels ~ 1.5 ppm
Remarks:	SEE RPT, DOB TELECON W/M&E, 4K UGT FAILED PETROTITE @ GROSS RATE. TANK FIXED & PASSED RETEST.

All TTF:

Facility ID:	9409889
Spill Number:	9409889
Spill Tank Test:	1543277
Site ID:	327666
Tank Number:	Not reported
Tank Size:	0
Material:	0008
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Site ID:	327666
Operable Unit ID:	1003862
Operable Unit:	01
Material ID:	375762
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

SPILLS:

Name:	NIMO TRANSFORMER OAKWOOD RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	0405104 / 2004-08-30
Facility ID:	0405104
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327661
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	4217
Spill Date:	2004-08-10
Investigator:	WEBLAIN
Referred To:	Not reported
Reported to Dept:	2004-08-10
CID:	444
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-08-10
Spill Record Last Update:	2012-07-18
Spiller Name:	BARBARA SCHEURER
Spiller Company:	TRANSFORMER PAD [NIMO]
Spiller Address:	235 OAKWOOD AVE
Spiller Company:	001
Contact Name:	BARBARA SCHEURER
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BLAIN 8/30/04 Blain contacted Barb Schuerer, NIMO. Non-PCB oil. cleaned up. PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374.
Remarks:	TRANSFORMER DETERIORATED AND STARTED TO LEAK: CREW ON SCENE AND

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

HAZMAT ON WAY: SPEEDI DRI AND PADS PLACED: 2 QUARTS SPILLED OUT:

All Materials:

Site ID:	327661
Operable Unit ID:	887978
Operable Unit:	01
Material ID:	489122
Material Code:	0020A
Material Name:	transformer oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Site ID:	327661
Operable Unit ID:	887978
Operable Unit:	01
Material ID:	489123
Material Code:	0020A
Material Name:	transformer oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NIMO TRANSFORMER OAKWOOD RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	0405144 / 2004-08-30
Facility ID:	0405144
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327662
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	4217
Spill Date:	2004-08-10
Investigator:	WEBLAIN
Referred To:	Not reported
Reported to Dept:	2004-08-10
CID:	407
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Date Entered In Computer:	2004-08-10
Spill Record Last Update:	2012-07-18
Spiller Name:	TOM SULLIVAN
Spiller Company:	NIMO
Spiller Address:	235 OAKWOOD AVE
Spiller Company:	001
Contact Name:	TOM SULLIVAN
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BLAIN 8/30/2004 Blain contacted NIMO. Non-PCB oil, cleaned up. PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374.
Remarks:	Spill is contained.

All Materials:

Site ID:	327662
Operable Unit ID:	887998
Operable Unit:	01
Material ID:	489188
Material Code:	0020A
Material Name:	transformer oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NIMO BLDG OAKWOOD AVE RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	0405710 / 2004-11-16
Facility ID:	0405710
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327663
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	4217
Spill Date:	2004-08-25
Investigator:	WEBLAIN
Referred To:	Not reported
Reported to Dept:	2004-08-25
CID:	408
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Date Entered In Computer:	2004-08-25
Spill Record Last Update:	2012-07-18
Spiller Name:	TOM SULLIVAN
Spiller Company:	NIAGRA[SP]MOHAWK BLD NIMO
Spiller Address:	235 OAKWOOD AVE.
Spiller Company:	001
Contact Name:	TOM SULLIVAN
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Factory labeled non-PCB, remediation complete. PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374.
Remarks:	CONTAINED AT THE SITE AND HAZMAT CREW IS ON ITS WAY TO CLEAN IT UP.

All Materials:

Site ID:	327663
Operable Unit ID:	888460
Operable Unit:	01
Material ID:	486517
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NIMO OAKWOOD AVE O/W SEP RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	8708047 / 1988-07-05
Facility ID:	8708047
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327664
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	B3
SWIS:	4217
Spill Date:	1987-12-17
Investigator:	MCDONALD
Referred To:	Not reported
Reported to Dept:	1987-12-17
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	1988-07-05
Cleanup Meets Std:	True
Last Inspection:	1987-12-22
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1987-12-23
Spill Record Last Update:	2012-07-18

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Spiller Name:	Not reported
Spiller Company:	NIAGARA MOHAWK NIMO
Spiller Address:	1125 BROADWAY
Spiller Company:	001
Contact Name:	Not reported
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374.
Remarks:	OIL/WATER SEPARATOR OVERFILLED, SOME TO STORM DRAIN. NIMO TO CLEANUP

All Materials:

Site ID:	327664
Operable Unit ID:	912370
Operable Unit:	01
Material ID:	463443
Material Code:	0015
Material Name:	motor oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Sewer
Oxygenate:	Not reported

Site ID:	327664
Operable Unit ID:	912370
Operable Unit:	01
Material ID:	463444
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	500.00
Units:	G
Recovered:	.00
Resource Affected:	Sewer
Oxygenate:	Not reported

Name:	NIMO MAINT CTR OAKWOOD RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	9206473 / 1992-12-07
Facility ID:	9206473
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327665
DEC Region:	4
Spill Cause:	Other
Spill Class:	C3
SWIS:	4217
Spill Date:	1992-09-03
Investigator:	WEBLAIN
Referred To:	Not reported
Reported to Dept:	1992-09-03

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	1992-09-03
Cleanup Meets Std:	True
Last Inspection:	1992-09-03
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1992-09-08
Spill Record Last Update:	2012-07-18
Spiller Name:	Not reported
Spiller Company:	NIAGARA MOHAWK NIMO MAIN
Spiller Address:	OAKWOOD AVE RT 40
Spiller Company:	001
Contact Name:	Not reported
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BLAIN PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374.
Remarks:	FOUND CONT. SOIL FROM LEAKING LIFT CYLINDER, 4-5YDS STOCKPILED. BLAIN @ SITE-MINOR PROBLEM.

All Materials:

Site ID:	327665
Operable Unit ID:	970170
Operable Unit:	01
Material ID:	410634
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NIMO OAKWOOD AVE RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	9511298 / 1996-07-12
Facility ID:	9511298
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327667
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	4217
Spill Date:	1995-12-06
Investigator:	WEBLAIN
Referred To:	Not reported
Reported to Dept:	1995-12-07

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

CID:	216
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1995-12-07
Spill Record Last Update:	2012-07-18
Spiller Name:	MARTIN CONDON
Spiller Company:	NIAGARA MOHAWK NIMO
Spiller Address:	235 OAKWOOD AVENUE
Spiller Company:	001
Contact Name:	MARTIN CONDON
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BLAIN NO RESPONSE. HOTLINE HAD SPILLER AS NOMO . PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374.
Remarks:	EMPLOYEES WERE PUMPING OIL TO AN OUTSIDE DRUM ALARM ON OUTSIDE DRUM NEVER ACTIVATED CAUSEING A OVERFLOW

All Materials:

Site ID:	327667
Operable Unit ID:	1025523
Operable Unit:	01
Material ID:	358646
Material Code:	0015
Material Name:	motor oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	15.00
Units:	G
Recovered:	15.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NIMO GARAGE TRANSFORMER OAKWOOD RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	9800231 / 1998-04-06
Facility ID:	9800231
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327668
DEC Region:	4
Spill Cause:	Human Error
Spill Class:	C4
SWIS:	4217
Spill Date:	1998-04-06
Investigator:	WEBLAIN
Referred To:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Reported to Dept:	1998-04-06
CID:	233
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1998-04-06
Spill Record Last Update:	2012-07-18
Spiller Name:	BILL LYSOGORSKI
Spiller Company:	NIAGARA MOHAWK NIMO
Spiller Address:	5215 WESTER TRNPK [SP]
Spiller Company:	001
Contact Name:	Not reported
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BLAIN PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374.
Remarks:	TRANSFORMER FELL FROM PALLET WHILE BE MOVED SPILL TO PAVEMENT AND GRAVEL AREA CLEAN UP BY CALLERS CREW

All Materials:

Site ID:	327668
Operable Unit ID:	1060738
Operable Unit:	01
Material ID:	325774
Material Code:	0020A
Material Name:	transformer oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	2.00
Units:	G
Recovered:	2.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NATIONAL GRID OAKWOOD AVE (NIMO) RT 40
Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	0800093 / 2008-04-03
Facility ID:	0800093
Facility Type:	ER
DER Facility ID:	263775
Site ID:	395793
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	4217
Spill Date:	2008-04-02
Investigator:	WEBLAIN
Referred To:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Reported to Dept:	2008-04-02
CID:	404
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2008-04-02
Spill Record Last Update:	2012-07-18
Spiller Name:	BARBARA SCHERER [SP] BARBARA SCHEURER
Spiller Company:	NATIONAL GRID (NIMO)
Spiller Address:	235 OAKWOOD AVE
Spiller Company:	999
Contact Name:	BARBARA SCHUERER
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	minor. non-pcb closed
Remarks:	leaky transformer in storage area; Hazmat crew in route; it is non pcb; on gravel and concrete

All Materials:

Site ID:	395793
Operable Unit ID:	1152734
Operable Unit:	01
Material ID:	2143513
Material Code:	0016A
Material Name:	non PCB oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Site ID:	395793
Operable Unit ID:	1152734
Operable Unit:	01
Material ID:	2143528
Material Code:	0020A
Material Name:	transformer oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NATIONAL GRID
Address:	235 OAKWOOD AVE
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	2203438 / 2022-09-06

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Facility ID:	2203438
Facility Type:	ER
DER Facility ID:	529286
Site ID:	639545
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	4217
Spill Date:	2022-07-20
Investigator:	AXODONNE
Referred To:	Not reported
Reported to Dept:	2022-07-20
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2022-07-20
Spill Record Last Update:	2022-09-06
Spiller Name:	MATT ROUTE
Spiller Company:	NATIONAL GRID
Spiller Address:	235 OAKWOOD AVE
Spiller Company:	999
Contact Name:	JOHN WENSLEY
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	07.20.22 - email sent to Matt Root for cleanup detail. aod 07.20.22 - 5 gallon spill at Troy service center. Equipment failure on gravel and stone. 09.06.22 - Hydraulic line break resulted in hydraulic oil spill on roadway and adjacent shoulder. Crew hand dug comamintated soil. Spread speedy dry and shovel up. Load all waste into drum for disposal. closed. aod
Remarks:	CLEANUP PENDING

All Materials:

Site ID:	639545
Operable Unit ID:	1386600
Operable Unit:	01
Material ID:	2401392
Material Code:	0020A
Material Name:	transformer oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name: NIMO SERV CTR OAKWOOD AVE RT 40

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Address:	235 OAKWOOD AVE RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	0212237 / 2003-11-13
Facility ID:	0212237
Facility Type:	ER
DER Facility ID:	263775
Site ID:	327660
DEC Region:	4
Spill Cause:	Human Error
Spill Class:	C3
SWIS:	4217
Spill Date:	2003-03-13
Investigator:	WEBLAIN
Referred To:	Not reported
Reported to Dept:	2003-03-13
CID:	365
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2003-03-13
Spill Record Last Update:	2012-07-18
Spiller Name:	CALLER
Spiller Company:	NIAGARA MOHAWK NIMO
Spiller Address:	OAKWOOD AV
Spiller Company:	001
Contact Name:	TOM SULLIVAN
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BLAIN PBS 4-429503; see 8708047, 9206473, 9409889, 9511298, 9800231, 0212237, 0405104, 0405144, 0405710, 0509374. 11/13/2003 NIMO reports factory labeled non-PCB. Cleanup complete.
Remarks:	forklift driver hit a pad mounted transformer w/ the forklift causing spill to concrete - clean up in progress

All Materials:

Site ID:	327660
Operable Unit ID:	865689
Operable Unit:	01
Material ID:	511973
Material Code:	0020A
Material Name:	transformer oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	30.00
Units:	G
Recovered:	25.00
Resource Affected:	Soil
Oxygenate:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Name:	NATIONAL GRID TR#4780 NIMO OAKWOOD RT 40
Address:	235 OAKWOOD AVE EXT RT 40
City,State,Zip:	TROY, NY
Spill Number/Closed Date:	0704961 / 2007-08-16
Facility ID:	0704961
Facility Type:	ER
DER Facility ID:	334597
Site ID:	385210
DEC Region:	4
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	4217
Spill Date:	2007-08-01
Investigator:	weblain
Referred To:	Not reported
Reported to Dept:	2007-08-01
CID:	444
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2007-08-01
Spill Record Last Update:	2012-07-18
Spiller Name:	BARABRA SCHEURERE [SP] BARBARA SCHEURER
Spiller Company:	NATIONAL GRID TR#4780 (NIMO)
Spiller Address:	235 OAKWOOD AVE EXT
Spiller Company:	999
Contact Name:	BARABRA SCHEURERE [SP] BARBARA SCHEURER
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	hydraulic oil. minor.
Remarks:	HOSE FAILED AND IS ALL CONTAINED AND IN PROCESS OF CLEANING UP

All Materials:

Site ID:	385210
Operable Unit ID:	1142485
Operable Unit:	01
Material ID:	2132722
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	7.00
Units:	G
Recovered:	7.00
Resource Affected:	Soil
Oxygenate:	Not reported

Click this hyperlink while viewing on your computer to access
17 additional NY SPILL: record(s) in the EDR Site Report.

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

NY MANIFEST:

EPA ID:	NYD980788442
Country:	USA
Name:	Niagara Mohawk Power Corp
Address:	235 OAKWOOD AVE. EXT.
Address 2:	Not reported
City,State,Zip:	TROY, NY 13202-4298
Zip 4:	Not reported
Location Address 1:	235 OAKWOOD AVE
Location Address 2:	Not reported
Location City,State,Zip:	TROY, NY 12182
Location Zip 4:	1600
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Niagara Mohawk Power Corp
Mailing Contact:	Niagara Mohawk Power Corp
Mailing Address 1:	1125 BROADWAY
Mailing Address 2:	Not reported
Mailing City,State,Zip:	ALBANY, NY 12204
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	5184713502

Manifest Data:

Document ID:	NYC3140436
Manifest Status:	Not reported
Trans1 State ID:	NYRH6932
Year:	1994
Trans2 State ID:	Not reported
Generator Ship Date:	07/22/1994
Trans1 Recv Date:	07/22/1994
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/22/1994
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD986872869
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00008
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	Ignitable Waste
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYG2923641
Manifest Status:	Not reported
Trans1 State ID:	TPZ409NJ
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	10/15/2001
Trans1 Recv Date:	10/15/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/22/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	NJD071629976
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD981113749
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B004
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	01142

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Units: Kilograms
Number of Containers: 006
Container Type: Metal boxes, cartons, cases (including roll-offs)
Handling Method: Recycle
Specific Gravity: 01.00

Document ID: NYG2907558
Manifest Status: Not reported
Trans1 State ID: 0726992ME
Year: 2001
Trans2 State ID: Not reported
Generator Ship Date: 04/27/2001
Trans1 Recv Date: 04/27/2001
Trans2 Recv Date: Not reported
TSD Site Recv Date: 05/04/2001
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD980788442
Trans1 EPA ID: NYD986899912
Trans2 EPA ID: Not reported
TSDF ID 1: ALD983167891
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: B006
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00136
Units: Kilograms
Number of Containers: 001
Container Type: Metal drums, barrels, kegs
Handling Method: Recycle
Specific Gravity: 01.00

Document ID: NYC1837293
Manifest Status: Not reported
Trans1 State ID: NYEC2076
Year: 1992
Trans2 State ID: Not reported
Generator Ship Date: 08/14/1992
Trans1 Recv Date: 08/14/1992
Trans2 Recv Date: Not reported
TSD Site Recv Date: 08/14/1992
Part A Recv Date: Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD986872869
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00045
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	Ignitable Waste
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00027
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYC2254454
Manifest Status:	Not reported
Trans1 State ID:	NYIM5676
Year:	1993
Trans2 State ID:	Not reported
Generator Ship Date:	05/04/1993
Trans1 Recv Date:	05/04/1993
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/04/1993
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD986872869

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00008
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	Ignitable Waste
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Document ID:	NYB4020552
Manifest Status:	Not reported
Trans1 State ID:	PB9830NY
Year:	1997
Trans2 State ID:	Not reported
Generator Ship Date:	06/05/1997
Trans1 Recv Date:	06/05/1997
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/05/1997
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	NYD980769947
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD000730408
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Mercury
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00499
Units:	Pounds
Number of Containers:	003
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	01.00
Waste Code 7:	The Following Spent Nonhalogenated Solvents: Xylene, Acetone, Ethyl Acetate, Ethyl Benzene, Ethyl Ether, Methyl Isobutyl Ketone, N-Butyl Alcohol, Cyclohexanone, And Methanol; All Spent Solvent Mixtures/Blends Containing, Before Use, Only The Above Spent Nonhalogenated Solvents; And All Spent Solvent Mixtures/Blends Containing, Before Use, One Or More Of The Above Nonhalogenated Solvents, And A Total Of Ten Percent Or More (By Volume) Of One Or More Of Those Solvents Listed In F001, F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00091
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYC2313933
Manifest Status:	Not reported
Trans1 State ID:	NYIM5676
Year:	1993
Trans2 State ID:	Not reported
Generator Ship Date:	05/27/1993
Trans1 Recv Date:	05/27/1993
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/27/1993
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD986872869
TSDF ID 2:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00008
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	Ignitable Waste
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Document ID:	NYC3364345
Manifest Status:	Not reported
Trans1 State ID:	NYGS7503
Year:	1994
Trans2 State ID:	Not reported
Generator Ship Date:	12/06/1994
Trans1 Recv Date:	12/06/1994
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/06/1994
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD986872869
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00008
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	Ignitable Waste
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYC1888367
Manifest Status:	Not reported
Trans1 State ID:	NYGS7503
Year:	1992
Trans2 State ID:	Not reported
Generator Ship Date:	10/12/1992
Trans1 Recv Date:	10/12/1992
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/12/1992
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD986872869
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00045
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	Ignitable Waste
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00027
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYG2442537
Manifest Status:	Not reported
Trans1 State ID:	AA709F
Year:	2000
Trans2 State ID:	Not reported
Generator Ship Date:	11/07/2000
Trans1 Recv Date:	11/07/2000
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/08/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	NJD071629976
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD981113749
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B004
Waste Code 2:	Not reported
Waste Code 3:	Not reported

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00345
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Recycle
Specific Gravity:	01.00
Document ID:	NYG2442555
Manifest Status:	Not reported
Trans1 State ID:	AA709F
Year:	2000
Trans2 State ID:	Not reported
Generator Ship Date:	09/26/2000
Trans1 Recv Date:	09/26/2000
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/03/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980788442
Trans1 EPA ID:	NJD071629978
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD981113749
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B004
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00937
Units:	Kilograms
Number of Containers:	004
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	B004
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00205
Units:	Kilograms

NIAGARA MOHAWK POWER CORP (Continued) **S108294880**

Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Click this hyperlink while viewing on your computer to access
105 additional NY MANIFEST: record(s) in the EDR Site Report.

I49 **SYRACUSE HOUSING AUTHORITY BUILDING & GROUNDS** **RCRA-SQG** **1012211705**
WNW **218 NEW ST** **NY MANIFEST** **NYR000171124**
1/8-1/4 **SYRACUSE, NY 13202**
0.135 mi.
714 ft. **Site 2 of 3 in cluster I**

Relative: **Lower**

Actual: **397 ft.**

RCRA Listings:

Date Form Received by Agency:		20100105
Handler Name:		Syracuse Housing Authority Building & Grounds
Handler Address:		New St
Handler City,State,Zip:		SYRACUSE, NY 13202
EPA ID:		NYR000171124
Contact Name:		WILLIAM W GEHRKE
Contact Address:		NEW ST
Contact City,State,Zip:		SYRACUSE, NY 13202
Contact Telephone:		315-470-4315 x4315
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		02
Land Type:		Other
Federal Waste Generator Description:		Small Quantity Generator
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Handler Activities
State District Owner:		Ny
State District:		NYSDEC R7
Mailing Address:		NEW ST
Mailing City,State,Zip:		SYRACUSE, NY 13202
Owner Name:	Syracuse Housing Authority	
Owner Type:		Other
Operator Name:	Syracuse Housing Authority	
Operator Type:		Other
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported

SYRACUSE HOUSING AUTHORITY BUILDING & GROUNDS (Continued) **1012211705**

Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D002
Waste Description:	Corrosive Waste

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY	
Legal Status:	Other
Date Became Current:	19890101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name: SYRACUSE HOUSING AUTHORITY	
Legal Status:	Other
Date Became Current:	19400101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

SYRACUSE HOUSING AUTHORITY BUILDING & GROUNDS (Continued) **1012211705**

Historic Generators:
- Receive Date: 20100105
- Handler Name: SYRACUSE HOUSING AUTHORITY BUILDING & GROUNDS
- Federal Waste Generator Description: Small Quantity Generator
- State District Owner: Ny
- Large Quantity Handler of Universal Waste: No
- Recognized Trader Importer: No
- Recognized Trader Exporter: No
- Spent Lead Acid Battery Importer: No
- Spent Lead Acid Battery Exporter: No
- Current Record: Yes
- Non Storage Recycler Activity: Not reported
- Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
- NAICS Code: 92511
- NAICS Description: Administration Of Housing Programs

Facility Has Received Notices of Violations:
- Violations: No Violations Found

Evaluation Action Summary:
- Evaluations: No Evaluations Found

NY MANIFEST:
- EPA ID: NYR000171124
- Country: USA
- Name: Syracuse Housing Authority Building & Grounds
- Address: 218 NEW ST
- Address 2: Not reported
- City,State,Zip: SYRACUSE, NY 13202
- Zip 4: Not reported
- Location Address 1: 218 NEW ST
- Location Address 2: Not reported
- Location City,State,Zip: SYRACUSE, NY 13202
- Location Zip 4: Not reported
- Facility Status: Not reported
- Total Tanks: Not reported
- Code: BP

Mailing:
- Mailing Name: Syracuse Housing Authority Building & Grounds
- Mailing Contact: Mark Denny
- Mailing Address 1: 516 BURT STREET
- Mailing Address 2: Not reported
- Mailing City,State,Zip: SYRACUSE, NY 13202
- Mailing Zip 4: Not reported
- Mailing Country: USA
- Mailing Phone: 3154704315

Manifest Data:
- Document ID: Not reported
- Manifest Status: Not reported
- Trans1 State ID: NYR000115733

SYRACUSE HOUSING AUTHORITY BUILDING & GROUNDS (Continued) **1012211705**

Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	01/13/2010
Trans1 Recv Date:	01/13/2010
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/22/2010
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000171124
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	002474327FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Corrosive Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	25
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

I50 **SYRACUSE HOUSING AUTHORITY - NEW STREET** **PA MANIFEST** **S111771708**
WNW **218 NEW STREET** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.135 mi.
714 ft. **Site 3 of 3 in cluster I**

Relative: PA MANIFEST:
Lower

Name:	SYRACUSE HOUSING AUTHORITY - NEW STREET
Address:	218 NEW STREET
City,State,Zip:	SYRACUSE, NY 13202
Year:	2010
Manifest Number:	002474327FLE
Manifest Type:	T

Actual:
397 ft.

SYRACUSE HOUSING AUTHORITY - NEW STREET (Continued) **S111771708**

Generator EPA ID:	NYR000171124
Generator Date:	01/13/2010
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	NULL
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D002
Container Number:	1
Container Type:	DF
Waste Quantity:	25
Unit:	G
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

51
WNW
1/8-1/4
0.135 mi.
715 ft.

NYS TEAMSTERS **NY LTANKS** **S100130095**
NEW STREET **N/A**
SYRACUSE, NY

Relative:
Lower

Actual:
397 ft.

LTANKS:

Name:	NYS TEAMSTERS
Address:	NEW STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9001641 / 1990-09-13
Facility ID:	9001641
Site ID:	100774
Spill Date:	1990-05-11
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Cleanup Ceased:	1990-08-27
SWIS:	3415
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1990-05-11
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1990-06-01
Spill Record Last Update:	1995-06-02
Spiller Name:	Not reported
Spiller Company:	NYS TEAMSTERS RETIRE FUND
Spiller Address:	7 RUTGERS ST

NYS TEAMSTERS (Continued) **S100130095**

Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	89437
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 09/13/90: SOME CONTAMINATED SOIL REMOVED FROM THE SITE.
Remarks:	CONTACT BRAD SMITH SUTTON REAL ESTATE 424-1111 PETRO-TITE TEST FAILUREVENT PROBLEM SUSPECTED.

All Materials:

Site ID:	100774
Operable Unit ID:	939951
Operable Unit:	01
Material ID:	439970
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	Not reported
Recovered:	5.00
Resource Affected:	Soil
Oxygenate:	Not reported

J52 **EAST ADAMS REDEVELOPMENT - PHASE I AREA** **NY BROWNFIELDS** **S131764059**
NW **100 ANGELOU TERRACE** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.153 mi.
809 ft. **Site 1 of 8 in cluster J**

Relative: **Lower**

Actual: **397 ft.**

BROWNFIELDS:

Name:	EAST ADAMS REDEVELOPMENT - PHASE I AREA
Address:	100 ANGELOU TERRACE
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	658151
Acres:	3.280
HW Code:	C734162
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	10/19/2023
Record Updated Date:	03/21/2024
Update By:	LSZINOMA
Site Description:	"03/20/2024 Site was denied from the Brownfield Cleanup Program (BCP). Based upon review of the BCP application, the proposed site is not a brownfield site as defined in Article 27, Title 14 of the Environmental Conservation Law. Location: The site is located at 100 Angelou Terrace within an urban, mixed-use area in the City of Syracuse, New York. The site is located in the northern portion of an about 11.10-acre tax parcel, identified as Onondaga County Tax Parcel 095.-08-01.0. The site is bound by East Adams Street followed by a parking garage at 817-835 South State Street to the north, South Townsend Street followed by a residential building at 1031-1059 South

EAST ADAMS REDEVELOPMENT - PHASE I AREA (Continued) **S131764059**

Townsend Street and Adams Street to the east, residential buildings at 301 311 East Taylor Street to the south, and South State Street followed by a fire station at 900 South State Street and an institutional building at 701 South Warren Street to the west. The site is improved with six, two-story multi-unit residential buildings and associated asphalt-paved parking lots and access roadways in the south-central part of the site. The remainder of the site is comprised of landscaped areas. The area surrounding the site consists of residential, commercial, institutional, and industrial properties. Site Features: According to the May 2023 Phase I Environmental Site Assessment (ESA) and the July 2023 Phase II ESA prepared by EA engineering, P.C. and Its Affiliate EA Science and Technology (EA), the elevation of the site is about elevation (el) 398 feet1. The topography of the site is generally flat with the surrounding area gently sloping towards the west. Current Zoning and Land Use: According to the Rezone Syracuse ordinance and City of Syracuse Zoning Map, the site is located within an MX-2: Neighborhood Center District. The MX-2: Neighborhood Center zoning district is generally characterized as pedestrian-friendly, transit-supportive mix of medium to higher density residential uses and non-residential uses that offer goods and services to surrounding neighborhoods. The surrounding properties are zoned for MX-2: Neighborhood Center Districts, MX-3: Mixed-Use Transition, MX-5: Central Business District, LI: Light Industrial and Employment, and OS: Open Space. Land use within a half-mile radius is urban and includes residential, commercial, institutional/public services, industrial, vacant land, and public parks. The nearest ecological receptor is the Onondaga Creek, located approximately 0.4 miles west of the site. At present, the site is occupied by six residential buildings, asphalt-paved parking lots and access roadways, and landscaped areas. Past Use of the Site: Historical documents indicate that the site has been located in a residential and commercial area since as early as 1892. By 1892, the site was developed with several one- to two-story dwellings and a one-story church in the southeastern part of the site. Historical uses of the site also included a fire department (1910 to 1953), junk yard (1910 to 1961), church (1961 to 1982), a gym and auditorium (1951 to 1961), and auto parking (1951). By 1989, the site was occupied by the Syracuse Housing Authority and developed in its present-day configuration. Site Geology and Hydrogeology: According to the U.S. Department of Agriculture s (USDA) Natural Resources Conservation Service (NRCS) Soil Survey Geographic (SSURGO) data for the site, soils at the site are comprised primarily of urban land. Urban land is described as excavated, filled, and made land. According to the Phase II ESA conducted by EA, soil at the site consists of historic fill comprised primarily of brown sand, silt, and clay with varying amounts of gravel, clay, brick, asphalt, glass, and tile to about 3 feet below grade surface (bgs). This layer is underlain by brown to gray silt and clay, fine-grained sand, and gravel to the termination depth of the borings (about 15 feet bgs). Bedrock was not encountered during the investigation. Based on review of the Geologic Map of New York, Finger Lakes Sheet (Fisher, Isachsen, Rickard, dated March 1970) , the site is underlain by bedrock of the Syracuse Foundation, consisting of dolostone, shale, gypsum and salt. Based on measurements collected during the Phase II ESA conducted by EA, groundwater at the site flows to the northwest, following the local topography, towards Onondaga Creek. Groundwater was observed at about 7.3 to 10.3 feet bgs (corresponding to el.

EAST ADAMS REDEVELOPMENT - PHASE I AREA (Continued) **S131764059**

	395.21 to el. 390.23). "
Env Problem:	"Information submitted with the BCP application regarding the environmental condition at the site are currently under review and will be revised as additional information becomes available."
Health Problem:	"Information submitted with the BCP application regarding the conditions at the site are currently under review and will be revised as additional information becomes available."
Dump:	Not reported
Structure:	Not reported
Lagoon:	Not reported
Landfill:	Not reported
Pond:	Not reported
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	Not reported
Record Upd:	Not reported
Updated By:	Not reported
Own Op:	4
Sub Type:	NNN
Owner Name:	William J Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Rene Battelle
Owner Company:	Onondaga County Public Libraries-Central Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America
Own Op:	1
Sub Type:	NNN
Owner Name:	William J Simmons
Owner Company:	Syracuse Housing Authority
Owner Address:	516 Burt Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Allyson Carpenter
Owner Company:	East Adams Phase I. L.P.
Owner Address:	100 North Broadway, Suite 100
Owner Addr2:	Not reported
Owner City,St,Zip:	St. Louis, MO 63102
Owner Country:	United States of America
HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	Not reported
Cross Ref Type Code:	Not reported

EAST ADAMS REDEVELOPMENT - PHASE I AREA (Continued) **S131764059**

Cross Ref Type:	Not reported
Record Added Date:	Not reported
Record Updated:	Not reported
Updated By:	Not reported

K53 **1210 S STATE ST** **US BROWNFIELDS** **1027025290**
SW **1210 S STATE ST** **FINDS** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.154 mi.
815 ft. **Site 1 of 3 in cluster K**

Relative: **Lower**
Actual: **395 ft.**

US BROWNFIELDS:

Name:	1210 S State St
Address:	1210 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249193
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-10.0
Parcel Size:	0.11
Latitude:	43.03782683
Longitude:	-76.147597132
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	2021-03-19 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2022-04-06 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y

1210 S STATE ST (Continued) **1027025290**

Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported

1210 S STATE ST (Continued) **1027025290**

Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2762
Below Poverty Percent:	50.1
Meidan Income:	1524
Meidan Income Number:	3821
Meidan Income Percent:	69.31
Vacant Housing Number:	280
Vacant Housing Percent:	13.26
Unemployed Number:	375
Unemployed Percent:	6.8

Name:	1210 S State St
Address:	1210 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249193
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-10.0
Parcel Size:	0.11
Latitude:	43.03782683
Longitude:	-76.147597132
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II SAP
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II SAP
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255919
Start Date:	2021-09-05 00:00:00
Ownership Entity:	Private

1210 S STATE ST (Continued) **1027025290**

Additional Institutional Controls Information:	Not reported
Completion Date:	2022-02-25 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported

1210 S STATE ST (Continued) **1027025290**

Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2762
Below Poverty Percent:	50.1
Meidan Income:	1524
Meidan Income Number:	3821
Meidan Income Percent:	69.31
Vacant Housing Number:	280
Vacant Housing Percent:	13.26
Unemployed Number:	375
Unemployed Percent:	6.8

Name:	1210 S State St
Address:	1210 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249193
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-10.0
Parcel Size:	0.11
Latitude:	43.03782683
Longitude:	-76.147597132
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs

1210 S STATE ST (Continued) **1027025290**

Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported

1210 S STATE ST (Continued) **1027025290**

RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2762
Below Poverty Percent:	50.1
Meidan Income:	1524
Meidan Income Number:	3821
Meidan Income Percent:	69.31
Vacant Housing Number:	280
Vacant Housing Percent:	13.26
Unemployed Number:	375
Unemployed Percent:	6.8

Name:	1210 S State St
Address:	1210 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249193
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-10.0
Parcel Size:	0.11
Latitude:	43.03782683
Longitude:	-76.147597132
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported

1210 S STATE ST (Continued) **1027025290**

Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported

1210 S STATE ST (Continued) **1027025290**

RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2762
Below Poverty Percent:	50.1
Meidan Income:	1524
Meidan Income Number:	3821
Meidan Income Percent:	69.31
Vacant Housing Number:	280
Vacant Housing Percent:	13.26
Unemployed Number:	375
Unemployed Percent:	6.8

Name:	1210 S State St
Address:	1210 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249193
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation

1210 S STATE ST (Continued) **1027025290**

Grant Type:	Hazardous
Property Number:	094.-18-10.0
Parcel Size:	0.11
Latitude:	43.03782683
Longitude:	-76.147597132
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II SAP
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255919
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives

1210 S STATE ST (Continued) **1027025290**

	and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2762
Below Poverty Percent:	50.1
Meidan Income:	1524
Meidan Income Number:	3821
Meidan Income Percent:	69.31
Vacant Housing Number:	280

1210 S STATE ST (Continued) **1027025290**

Vacant Housing Percent:	13.26
Unemployed Number:	375
Unemployed Percent:	6.8
Name:	1210 S State St
Address:	1210 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249193
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-10.0
Parcel Size:	0.11
Latitude:	43.03782683
Longitude:	-76.147597132
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II SAP
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255919
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported

1210 S STATE ST (Continued) **1027025290**

IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported

1210 S STATE ST (Continued) **1027025290**

Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2762
Below Poverty Percent:	50.1
Meidan Income:	1524
Meidan Income Number:	3821
Meidan Income Percent:	69.31
Vacant Housing Number:	280
Vacant Housing Percent:	13.26
Unemployed Number:	375
Unemployed Percent:	6.8

FINDS:
Registry ID: 110071090134

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

54
NNE
1/8-1/4
0.159 mi.
837 ft.

SYRACUSE HOUSING AUTH - PIONEER HOMES **RCRA-SQG** **1010566801**
120-122 TYLER COURT **NY MANIFEST** **NYR000154492**
SYRACUSE, NY 13202

Relative:
Lower

Actual:
400 ft.

RCRA Listings:

Date Form Received by Agency:	20080205
Handler Name:	Syracuse Housing Auth - Pioneer Homes
Handler Address:	Tyler Court
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYR000154492
Contact Name:	WILLIAM W GEHRKE
Contact Address:	BURT ST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-470-4315
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Other
Federal Waste Generator Description:	Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	TYLER COURT
Mailing City,State,Zip:	SYRACUSE, NY 13202

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566801**

Owner Name:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D002
Waste Description:	Corrosive Waste

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	SYRACUSE HOUSING AUTH
Legal Status:	Other
Date Became Current:	19400101
Date Ended Current:	Not reported

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566801**

Owner/Operator Address: 516 BURT ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SYRACUSE HOUSING AUTH
Legal Status: Other
Date Became Current: 19400101
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20080205
Handler Name: SYRACUSE HOUSING AUTH - PIONEER HOMES
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080206
Handler Name: SYRACUSE HOUSING AUTH - PIONEER HOMES
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 92511
NAICS Description: Administration Of Housing Programs

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566801**

NY MANIFEST:

EPA ID:	NYR000154492
Country:	USA
Name:	Syracuse Housing Auth - Pioneer Homes
Address:	120-122 TYLER COURT
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	120-122 TYLER COURT
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Syracuse Housing Auth - Pioneer Homes
Mailing Contact:	William Gehile
Mailing Address 1:	516 BURT ST
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154704315

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	NYD980761191
Generator Ship Date:	03/12/2008
Trans1 Recv Date:	03/12/2008
Trans2 Recv Date:	03/21/2008
TSD Site Recv Date:	03/25/2008
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000154492
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	000885788FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Methane, Dichloro- (Or) Methylene Chloride
Waste Code b:	Not reported

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566801**

Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	NYD980761191
Generator Ship Date:	03/12/2008
Trans1 Recv Date:	03/12/2008
Trans2 Recv Date:	03/21/2008
TSD Site Recv Date:	03/25/2008
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000154492
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	000885788FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Corrosive Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported

SYRACUSE HOUSING AUTH - PIONEER HOMES (Continued) **1010566801**

Quantity:	165
Units:	Gallons (liquids only)
Number of Containers:	3
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

K55 **1212 S STATE ST** **US BROWNFIELDS** **1027140686**
SW **1212 S STATE ST** **FINDS** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.159 mi.
838 ft. **Site 2 of 3 in cluster K**

Relative: **Lower**
Actual: **395 ft.**

US BROWNFIELDS:

Name:	1212 S State St
Address:	1212 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249194
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-11.0
Parcel Size:	0.11
Latitude:	43.0377353
Longitude:	-76.147563102
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y

1212 S STATE ST (Continued) **1027140686**

Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported

1212 S STATE ST (Continued) **1027140686**

Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2699
Below Poverty Percent:	50.38
Meidan Income:	1562
Meidan Income Number:	3696
Meidan Income Percent:	68.99
Vacant Housing Number:	263
Vacant Housing Percent:	12.84
Unemployed Number:	369
Unemployed Percent:	6.89

Name:	1212 S State St
Address:	1212 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249194
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-11.0
Parcel Size:	0.11
Latitude:	43.0377353
Longitude:	-76.147563102
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported

1212 S STATE ST (Continued) **1027140686**

Cooperative Agreement Number:	96255719
Start Date:	2021-03-19 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2022-04-06 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported

1212 S STATE ST (Continued) **1027140686**

Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2699
Below Poverty Percent:	50.38
Meidan Income:	1562
Meidan Income Number:	3696
Meidan Income Percent:	68.99
Vacant Housing Number:	263
Vacant Housing Percent:	12.84
Unemployed Number:	369
Unemployed Percent:	6.89

Name:	1212 S State St
Address:	1212 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249194
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-11.0
Parcel Size:	0.11
Latitude:	43.0377353
Longitude:	-76.147563102
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II SAP
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported

1212 S STATE ST (Continued) **1027140686**

Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255919
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil

1212 S STATE ST (Continued) **1027140686**

RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2699
Below Poverty Percent:	50.38
Meidan Income:	1562
Meidan Income Number:	3696
Meidan Income Percent:	68.99
Vacant Housing Number:	263
Vacant Housing Percent:	12.84
Unemployed Number:	369
Unemployed Percent:	6.89

Name:	1212 S State St
Address:	1212 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249194
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-11.0
Parcel Size:	0.11
Latitude:	43.0377353
Longitude:	-76.147563102
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y

1212 S STATE ST (Continued) **1027140686**

Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II SAP
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255919
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported

1212 S STATE ST (Continued) **1027140686**

Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2699
Below Poverty Percent:	50.38
Meidan Income:	1562
Meidan Income Number:	3696
Meidan Income Percent:	68.99
Vacant Housing Number:	263
Vacant Housing Percent:	12.84
Unemployed Number:	369
Unemployed Percent:	6.89

Name:	1212 S State St
Address:	1212 S State St
City,State,Zip:	SYRACUSE, NY 13202

1212 S STATE ST (Continued) **1027140686**

Property ID:	249194
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-11.0
Parcel Size:	0.11
Latitude:	43.0377353
Longitude:	-76.147563102
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II SAP
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II SAP
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255919
Start Date:	2021-09-05 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2022-02-25 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported

1212 S STATE ST (Continued) **1027140686**

Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2699
Below Poverty Percent:	50.38
Meidan Income:	1562

1212 S STATE ST (Continued) **1027140686**

Meidan Income Number:	3696
Meidan Income Percent:	68.99
Vacant Housing Number:	263
Vacant Housing Percent:	12.84
Unemployed Number:	369
Unemployed Percent:	6.89
Name:	1212 S State St
Address:	1212 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249194
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-11.0
Parcel Size:	0.11
Latitude:	43.0377353
Longitude:	-76.147563102
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported

1212 S STATE ST (Continued) **1027140686**

Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported

1212 S STATE ST (Continued) **1027140686**

Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2699
Below Poverty Percent:	50.38
Meidan Income:	1562
Meidan Income Number:	3696
Meidan Income Percent:	68.99
Vacant Housing Number:	263
Vacant Housing Percent:	12.84
Unemployed Number:	369
Unemployed Percent:	6.89

FINDS:
Registry ID: 110071194772

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

J56 **SYRACUSE POLICE DEPT GAS DEPOT** **NY UST** **U003313254**
NW **916 S STATE ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.160 mi.
846 ft. **Site 2 of 8 in cluster J**

Relative:
Lower

Actual:
396 ft.

UST:

Name:	SYRACUSE POLICE DEPT GAS DEPOT
Address:	916 S STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-181803 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	406521.69565
UTM Y:	4765991.90851
Site Type:	Unknown

Affiliation Records:

Site Id:	45027
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE POLICE DEPT GAS DEPOT
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	511 S STATE ST
Address2:	Not reported

SYRACUSE POLICE DEPT GAS DEPOT (Continued) **U003313254**

City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 425-6165
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45027
Affiliation Type:	Mail Contact
Company Name:	SYRACUSE POLICE DEPT GAS DEPOT
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	511 S STATE ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 425-6165
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45027
Affiliation Type:	Facility Operator
Company Name:	SYRACUSE POLICE DEPT GAS DEPOT
Contact Type:	Not reported
Contact Name:	SYRACUSE POLICE DEPT GAS DEPOT
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 425-6165
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45027
Affiliation Type:	Emergency Contact
Company Name:	SYRACUSE POLICE DEPT GAS DEPOT
Contact Type:	Not reported
Contact Name:	SYRACUSE POLICE GARAGE
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 425-6165
EMail:	Not reported

SYRACUSE POLICE DEPT GAS DEPOT (Continued) **U003313254**

Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Tank Info:

Tank Number:	001
Tank ID:	129827
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	10000
Install Date:	10/01/1980
Date Tank Closed:	09/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number:	002
Tank ID:	129828
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	10000
Install Date:	10/01/1980
Date Tank Closed:	09/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

SYRACUSE POLICE DEPT GAS DEPOT (Continued) **U003313254**

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

J57 **SYRACUSE POLICE DEPT GAS DEPOT** **UST FINDER** **1028588826**
NW **916 S STATE ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.160 mi.
846 ft. **Site 3 of 8 in cluster J**

Relative:
Lower

Actual:
396 ft.

UST FINDER:

Object ID:	318245
Facility ID:	NY45027
Name:	SYRACUSE POLICE DEPT GAS DEPOT
Address:	916 S STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	2
TOS USTs:	0
Population 1500ft:	1786
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Low Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Closed UST(s)
Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.147611
Y Coord:	43.0408660000001
Latitude:	43.040866
Longitude:	-76.147611

UST FINDER:

Object ID:	1278206
Facility ID:	NY45027
Tank ID:	NY79341
Tank Status:	Closed
Installation Date:	1980/10/01 16:00:00+00
Removal Date:	Not reported

SYRACUSE POLICE DEPT GAS DEPOT (Continued) **1028588826**

Tank Capacity:	10000
Substances:	Not reported
Tank Wall Type:	Not reported
Object ID:	1278207
Facility ID:	NY45027
Tank ID:	NY71200
Tank Status:	Closed
Installation Date:	1980/10/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	10000
Substances:	Not reported
Tank Wall Type:	Not reported

K58 **1214 S STATE ST** **US BROWNFIELDS** **1027142013**
SW **1214 S STATE ST** **FINDS** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.163 mi.
862 ft. **Site 3 of 3 in cluster K**

Relative: **Lower**

Actual: **394 ft.**

US BROWNFIELDS:

Name:	1214 S State St
Address:	1214 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249195
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-12.0
Parcel Size:	0.11
Latitude:	43.037652612
Longitude:	-76.147505686
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II SAP
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255919
Start Date:	Not reported
Ownership Entity:	Private

1214 S STATE ST (Continued) **1027142013**

Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported

1214 S STATE ST (Continued) **1027142013**

Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2742
Below Poverty Percent:	50.14
Meidan Income:	1524
Meidan Income Number:	3786
Meidan Income Percent:	69.23
Vacant Housing Number:	276
Vacant Housing Percent:	13.18
Unemployed Number:	372
Unemployed Percent:	6.8

Name:	1214 S State St
Address:	1214 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249195
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-12.0
Parcel Size:	0.11
Latitude:	43.037652612
Longitude:	-76.147505686
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II SAP
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs

1214 S STATE ST (Continued) **1027142013**

Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255919
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported

1214 S STATE ST (Continued) **1027142013**

RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2742
Below Poverty Percent:	50.14
Meidan Income:	1524
Meidan Income Number:	3786
Meidan Income Percent:	69.23
Vacant Housing Number:	276
Vacant Housing Percent:	13.18
Unemployed Number:	372
Unemployed Percent:	6.8

Name:	1214 S State St
Address:	1214 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249195
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-12.0
Parcel Size:	0.11
Latitude:	43.037652612
Longitude:	-76.147505686
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II SAP
Start Date:	Not reported

1214 S STATE ST (Continued) **1027142013**

Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II SAP
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255919
Start Date:	2021-09-05 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2022-02-25 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported

1214 S STATE ST (Continued) **1027142013**

RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2742
Below Poverty Percent:	50.14
Meidan Income:	1524
Meidan Income Number:	3786
Meidan Income Percent:	69.23
Vacant Housing Number:	276
Vacant Housing Percent:	13.18
Unemployed Number:	372
Unemployed Percent:	6.8

Name:	1214 S State St
Address:	1214 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249195
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation

1214 S STATE ST (Continued) **1027142013**

Grant Type:	Hazardous
Property Number:	094.-18-12.0
Parcel Size:	0.11
Latitude:	43.037652612
Longitude:	-76.147505686
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	2021-03-19 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2022-04-06 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives

1214 S STATE ST (Continued) **1027142013**

	and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2742
Below Poverty Percent:	50.14
Meidan Income:	1524
Meidan Income Number:	3786
Meidan Income Percent:	69.23
Vacant Housing Number:	276

1214 S STATE ST (Continued) **1027142013**

Vacant Housing Percent:	13.18
Unemployed Number:	372
Unemployed Percent:	6.8
Name:	1214 S State St
Address:	1214 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249195
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-12.0
Parcel Size:	0.11
Latitude:	43.037652612
Longitude:	-76.147505686
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported

1214 S STATE ST (Continued) **1027142013**

IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported

1214 S STATE ST (Continued) **1027142013**

Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2742
Below Poverty Percent:	50.14
Meidan Income:	1524
Meidan Income Number:	3786
Meidan Income Percent:	69.23
Vacant Housing Number:	276
Vacant Housing Percent:	13.18
Unemployed Number:	372
Unemployed Percent:	6.8

Name:	1214 S State St
Address:	1214 S State St
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249195
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-18-12.0
Parcel Size:	0.11
Latitude:	43.037652612
Longitude:	-76.147505686
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Lead Other Metals PAHs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y

1214 S STATE ST (Continued) **1027142013**

Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Y
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	N
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Y
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Y
Additional Engineering Controls Information:	Phase II findings with exceedances of NYSDEC soil cleanup objectives and/or groundwater standards/guidance
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	N
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.11
NFA Letter Date Received:	Not reported

1214 S STATE ST (Continued) **1027142013**

Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2742
Below Poverty Percent:	50.14
Meidan Income:	1524
Meidan Income Number:	3786
Meidan Income Percent:	69.23
Vacant Housing Number:	276
Vacant Housing Percent:	13.18
Unemployed Number:	372
Unemployed Percent:	6.8

FINDS:
Registry ID: 110071198607

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

L59 **917 MONTGOMERY STREET AND BURT STREET** **US BROWNFIELDS** **1027025374**
WSW **917 MONTGOMERY STREET** **FINDS** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.167 mi.
883 ft. **Site 1 of 2 in cluster L**

Relative: US BROWNFIELDS:
Lower

Actual: Name:	917 Montgomery Street And Burt Street
396 ft. Address:	917 Montgomery Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	244994
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-07-05.0
Parcel Size:	0.21
Latitude:	43.038501681
Longitude:	-76.148664756
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.21
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2767
Below Poverty Percent:	50.29
Meidan Income:	1562
Meidan Income Number:	3805
Meidan Income Percent:	69.16
Vacant Housing Number:	276
Vacant Housing Percent:	13.08
Unemployed Number:	381
Unemployed Percent:	6.92

Name:	917 Montgomery Street And Burt Street
Address:	917 Montgomery Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	244994

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-07-05.0
Parcel Size:	0.21
Latitude:	43.038501681
Longitude:	-76.148664756
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase I Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Sampling and Analysis Plan Only
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	2020-09-17 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2021-01-06 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.21
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2767
Below Poverty Percent:	50.29
Meidan Income:	1562
Meidan Income Number:	3805
Meidan Income Percent:	69.16

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Vacant Housing Number:	276
Vacant Housing Percent:	13.08
Unemployed Number:	381
Unemployed Percent:	6.92
Name:	917 Montgomery Street And Burt Street
Address:	917 Montgomery Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	244994
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-07-05.0
Parcel Size:	0.21
Latitude:	43.038501681
Longitude:	-76.148664756
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Sampling and Analysis Plan Only
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.21
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2767
Below Poverty Percent:	50.29
Meidan Income:	1562
Meidan Income Number:	3805
Meidan Income Percent:	69.16
Vacant Housing Number:	276
Vacant Housing Percent:	13.08
Unemployed Number:	381
Unemployed Percent:	6.92

Name:	917 Montgomery Street And Burt Street
Address:	917 Montgomery Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	244994
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-07-05.0
Parcel Size:	0.21
Latitude:	43.038501681
Longitude:	-76.148664756
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Sampling and Analysis Plan Only
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Sampling and Analysis Plan Only
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	2019-09-05 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2022-07-06 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.21
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2767
Below Poverty Percent:	50.29
Meidan Income:	1562
Meidan Income Number:	3805
Meidan Income Percent:	69.16
Vacant Housing Number:	276
Vacant Housing Percent:	13.08
Unemployed Number:	381
Unemployed Percent:	6.92

Name:	917 Montgomery Street And Burt Street
Address:	917 Montgomery Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	244994
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-07-05.0
Parcel Size:	0.21
Latitude:	43.038501681
Longitude:	-76.148664756
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Sampling and Analysis Plan Only
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Start Date:	2019-09-05 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2022-07-06 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.21
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2767
Below Poverty Percent:	50.29
Meidan Income:	1562
Meidan Income Number:	3805
Meidan Income Percent:	69.16
Vacant Housing Number:	276
Vacant Housing Percent:	13.08
Unemployed Number:	381
Unemployed Percent:	6.92

Name:	917 Montgomery Street And Burt Street
Address:	917 Montgomery Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	244994
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-07-05.0
Parcel Size:	0.21
Latitude:	43.038501681
Longitude:	-76.148664756
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Sampling and Analysis Plan Only
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.21
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2767
Below Poverty Percent:	50.29
Meidan Income:	1562
Meidan Income Number:	3805
Meidan Income Percent:	69.16
Vacant Housing Number:	276
Vacant Housing Percent:	13.08
Unemployed Number:	381
Unemployed Percent:	6.92

Name:	917 Montgomery Street And Burt Street
Address:	917 Montgomery Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	244994
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-07-05.0
Parcel Size:	0.21
Latitude:	43.038501681
Longitude:	-76.148664756
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.21
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2767
Below Poverty Percent:	50.29
Meidan Income:	1562
Meidan Income Number:	3805
Meidan Income Percent:	69.16
Vacant Housing Number:	276
Vacant Housing Percent:	13.08
Unemployed Number:	381
Unemployed Percent:	6.92

Name:	917 Montgomery Street And Burt Street
Address:	917 Montgomery Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	244994
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Property Number:	094.-07-05.0
Parcel Size:	0.21
Latitude:	43.038501681
Longitude:	-76.148664756
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase I Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	2020-09-17 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2021-01-06 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.21
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2767
Below Poverty Percent:	50.29
Meidan Income:	1562
Meidan Income Number:	3805
Meidan Income Percent:	69.16
Vacant Housing Number:	276
Vacant Housing Percent:	13.08
Unemployed Number:	381

917 MONTGOMERY STREET AND BURT STREET (Continued) **1027025374**

Unemployed Percent: 6.92

FINDS:
Registry ID: 110071090222

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

J60 **NIAGARA MOHAWK A NATIONAL GRID COMPANY** **NY MANIFEST** **S130581177**
NW **900 SOUTH STATE STREET** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.174 mi.
920 ft. **Site 4 of 8 in cluster J**

Relative:
Lower

Actual:
396 ft.

NY MANIFEST:

EPA ID:	NYP000976662
Country:	USA
Name:	Niagara Mohawk A National Grid Company
Address:	900 SOUTH STATE STREET
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	900 SOUTH STATE STREET
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Niagara Mohawk A National Grid Company
Mailing Contact:	Niagara Mohawk
Mailing Address 1:	300 ERIE BOULEVARD W
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	8008393975

J61 **FIRE STATION #1** **NY UST** **U003313266**
NW **900 SOUTH STATE ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.174 mi.
920 ft. **Site 5 of 8 in cluster J**

Relative:
Lower

Actual:
396 ft.

UST:

Name:	FIRE STATION #1
Address:	900 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-181935 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	06/30/2027
UTM X:	406500.41583
UTM Y:	4766163.01145
Site Type:	Municipality (Incl. Waste Water Treatment Plants, Utilities, Swimming Pools, etc.)

Affiliation Records:

Site Id:	45039
Affiliation Type:	Mail Contact
Company Name:	CITY OF SYRACUSE FIRE DEPT
Contact Type:	Not reported
Contact Name:	ZACH SMITH
Address1:	FIRE MAINTENANCE
Address2:	312 STATE FAIR BLVD
City:	SYRACUSE
State:	NY
Zip Code:	13204
Country Code:	001
Phone:	(315) 448-4777
EMail:	ZSMITH@SYR.GOV
Fax Number:	Not reported
Modified By:	DJLASALL
Date Last Modified:	2024-07-17

Site Id:	45039
Affiliation Type:	Facility Owner
Company Name:	CITY OF SYRACUSE
Contact Type:	DEPUTYCHIEF - SYRACUSE FIRE DEPT
Contact Name:	ZACH SMITH
Address1:	CITY HALL - 233 EAST WASHINGTON ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 448-8200
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2022-04-26

Site Id:	45039
Affiliation Type:	Emergency Contact
Company Name:	CITY OF SYRACUSE FIRE DEPT
Contact Type:	Not reported
Contact Name:	CHIEF OF FIRE
Address1:	Not reported

FIRE STATION #1 (Continued) **U003313266**

Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(315) 473-3230
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DJLASALL
Date Last Modified:	2024-07-17

Site Id:	45039
Affiliation Type:	Facility Operator
Company Name:	FIRE STATION #1
Contact Type:	Not reported
Contact Name:	JEFF GROSSO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 473-5495
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2019-03-06

Tank Info:

Tank Number:	001
Tank ID:	129862
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	2000
Install Date:	12/01/1974
Date Tank Closed:	05/01/1995
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	0008
Common Name of Substance:	Diesel

Tightness Test Method:	11
Date Test:	05/01/1993
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
B00 - Tank External Protection - None

FIRE STATION #1 (Continued) **U003313266**

C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 002
Tank ID: 129863
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 2000
Install Date: 12/01/1974
Date Tank Closed: 05/01/1995
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 0008
Common Name of Substance: Diesel

Tightness Test Method: 11
Date Test: 05/01/1993
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 004
Tank ID: 137149
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 2500
Install Date: 05/01/1995
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 0008
Common Name of Substance: Diesel

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

FIRE STATION #1 (Continued) **U003313266**

A00 - Tank Internal Protection - None
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction Dispenser
F05 - Pipe External Protection - Jacketed
H05 - Tank Leak Detection - In-Tank System (ATG)
L02 - Piping Leak Detection - Interstitial - Manual Monitoring
B00 - Tank External Protection - None
E04 - Piping Secondary Containment - Double walled UG
G04 - Tank Secondary Containment - Double-Walled (Underground)

J62 **FIRE STATION #1** **UST FINDER** **1028588839**
NW **900 SOUTH STATE ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.174 mi.
920 ft. **Site 6 of 8 in cluster J**

Relative: **Lower**
Actual: **396 ft.**

UST FINDER:

Object ID:	318283
Facility ID:	NY45039
Name:	FIRE STATION #1
Address:	900 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Address Match Type:	Not reported
Open USTs:	1
Closed USTs:	2
TOS USTs:	0
Population 1500ft:	1951
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Open UST(s)
Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.1476049999999
Y Coord:	43.0426610000001
Latitude:	43.042661
Longitude:	-76.147605

UST FINDER:

Object ID:	1278080
Facility ID:	NY45039

FIRE STATION #1 (Continued) **1028588839**

Tank ID:	NY75944
Tank Status:	Closed
Installation Date:	1974/12/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	2000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1278081
Facility ID:	NY45039
Tank ID:	NY117945
Tank Status:	Closed
Installation Date:	1974/12/01 16:00:00+00
Removal Date:	Not reported
Tank Capacity:	2000
Substances:	Not reported
Tank Wall Type:	Not reported

Object ID:	1278082
Facility ID:	NY45039
Tank ID:	NY70628
Tank Status:	Open
Installation Date:	1995/05/01 15:59:59+00
Removal Date:	Not reported
Tank Capacity:	2500
Substances:	Not reported
Tank Wall Type:	Not reported

J63 **FIRE STATION #1** **NY AST** **A100472594**
NW **900 SOUTH STATE ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.174 mi.
920 ft. **Site 7 of 8 in cluster J**

Relative: **Lower**
Actual: **396 ft.**

AST:

Name:	FIRE STATION #1
Address:	900 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY 13202
Region:	STATE
DEC Region:	7
Site Status:	Active
Facility Id:	7-181935
Program Type:	PBS
UTM X:	406500.41583
UTM Y:	4766163.01145
Expiration Date:	06/30/2027
Site Type:	Municipality (Incl. Waste Water Treatment Plants, Utilities, Swimming Pools, etc.)

Affiliation Records:

Site Id:	45039
Affiliation Type:	Mail Contact
Company Name:	CITY OF SYRACUSE FIRE DEPT
Contact Type:	Not reported
Contact Name:	ZACH SMITH
Address1:	FIRE MAINTENANCE
Address2:	312 STATE FAIR BLVD
City:	SYRACUSE

FIRE STATION #1 (Continued) **A100472594**

State:	NY
Zip Code:	13204
Country Code:	001
Phone:	(315) 448-4777
EMail:	ZSMITH@SYR.GOV
Fax Number:	Not reported
Modified By:	DJLASALL
Date Last Modified:	2024-07-17

Site Id:	45039
Affiliation Type:	Facility Owner
Company Name:	CITY OF SYRACUSE
Contact Type:	DEPUTYCHIEF - SYRACUSE FIRE DEPT
Contact Name:	ZACH SMITH
Address1:	CITY HALL - 233 EAST WASHINGTON ST
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13202
Country Code:	001
Phone:	(315) 448-8200
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2022-04-26

Site Id:	45039
Affiliation Type:	Emergency Contact
Company Name:	CITY OF SYRACUSE FIRE DEPT
Contact Type:	Not reported
Contact Name:	CHIEF OF FIRE
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(315) 473-3230
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DJLASALL
Date Last Modified:	2024-07-17

Site Id:	45039
Affiliation Type:	Facility Operator
Company Name:	FIRE STATION #1
Contact Type:	Not reported
Contact Name:	JEFF GROSSO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 473-5495
EMail:	Not reported
Fax Number:	Not reported

FIRE STATION #1 (Continued) **A100472594**

Modified By: KCKEMP
Date Last Modified: 2019-03-06

Tank Info:

Tank Number: 102
Tank Id: 280124

Equipment Records:

C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
J06 - Dispenser - Tank Mounted Dispenser
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
E00 - Piping Secondary Containment - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
K00 - Spill Prevention - None
D00 - Pipe Type - No Piping
G12 - Tank Secondary Containment - Double-Walled (AG only)
L00 - Piping Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)

Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Pipe Model: Not reported
Install Date: 02/22/2019
Capacity Gallons: 1000
Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: MJGRIFFI
Last Modified: 05/09/2022
Material Name: gasoline

J64 **NIAGARA MOHAWK - A NATIONAL GRID CO** **RCRA NonGen / NLR** **1026498246**
NW **900 SOUTH STATE ST** **E MANIFEST** **NYP000976662**
1/8-1/4 **SYRACUSE, NY 13202**
0.174 mi.
920 ft. **Site 8 of 8 in cluster J**

Relative: **Lower**
Actual: **396 ft.**

RCRA Listings:

Date Form Received by Agency: 20201217
Handler Name: Niagara Mohawk - A National Grid Co
Handler Address: South State St
Handler City,State,Zip: SYRACUSE, NY 13202
EPA ID: NYP000976662
Contact Name: Not reported
Contact Address: Not reported
Contact City,State,Zip: Not reported
Contact Telephone: Not reported
Contact Fax: Not reported
Contact Email: Not reported
Contact Title: Not reported
EPA Region: 02
Land Type: Not reported

NIAGARA MOHAWK - A NATIONAL GRID CO (Continued) **1026498246**

Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Ny
State District:		NYSDEC R7
Mailing Address:		Not reported
Mailing City,State,Zip:		Not reported
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
202 GPRA Corrective Action Baseline:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No
Addressed Significant Non-Complier Universe:		No
Significant Non-Complier With a Compliance Schedule Universe:		No
Financial Assurance Required:		Not reported
Handler Date of Last Change:		20220411
Recognized Trader-Importer:		No
Recognized Trader-Exporter:		No
Importer of Spent Lead Acid Batteries:		No
Exporter of Spent Lead Acid Batteries:		No
Recycler Activity Without Storage:		No
Manifest Broker:		No
Sub-Part P Indicator:		No

Historic Generators:

Receive Date:	20200930

NIAGARA MOHAWK - A NATIONAL GRID CO (Continued) **1026498246**

Handler Name: NIAGARA MOHAWK, A NATIONAL GRID COMPANY
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20201217
Handler Name: NIAGARA MOHAWK - A NATIONAL GRID CO
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

E MANIFEST:
Manifest Tracking Number: 006546866GBF
Last Updated Date: 20201111
Shipped Date: 20201027
Received Date: 20201103
Manifest Status: Signed
Submission Type: DataImage5Copy
Origin Type: Service
Generator EPA ID: NYP000976662
Generator Name: Niagara Mohawk, A National Grid Company
Generator Location Street Number: 900
Generator Location Street 1: 900 SOUTH STATE STREET
Generator Location Street 2: Not reported
Generator Location City: SYRACUSE
Generator Location State: NY
Generator Location Zip: 13202
Generator Mail Street Number: 300
Generator Mail Street 1: ERIE BOULEVARD WEST
Generator Mail Street 2: Not reported
Generator Mail City: SYRACUSE

NIAGARA MOHAWK - A NATIONAL GRID CO (Continued) **1026498246**

Generator Mail Zip:	13202
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	MID000724831
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	49350 N I-94 SERVICE DR
Designated Facility Mail Street 2:	ATTN SYLWIA SCOTT
Designated Facility Mail City:	BELLEVILLE
Designated Facility Mail Zip:	48111
Designated Facility Mail State:	MI
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	49350 NORTH I94 SERVICE DRIVE
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	BELLEVILLE
Designated Facility Location Zip:	48111
Designated Facility Location State:	MI
Designated Facility Contact Company Name:	Michigan Disposal Waste Treatment Plant
Manifest Residue Indicator:	N
Rejection Indicator:	N

Transporter:

Manifest Tracking Number:	006546866GBF
Transporter Line Number:	1
Transporter EPA ID:	MAC300098399
Transporter Name:	Nrc East Environmental Services Inc

Manifest Tracking Number:	006546866GBF
Transporter Line Number:	2
Transporter EPA ID:	MAD084814136
Transporter Name:	Eq Northeast Inc

Waste Line:

Manifest Tracking Number:	006546866GBF
Waste Line Number:	1
U.S. DOT Hazardous Indicator:	Y
U.S. DOT ID Number:	NA3082
U.S. DOT Description:	Na3082, Hazardous Waste, Liquid, N.O.S., 9, Pgiii, Erg#171
Non-Hazardous Waste Description:	Not reported
Number of Containers:	5
Container Type Code:	DM
Container Type Description:	Metal drums, barrels, kegs
Waste Quantity:	1500
Quantity Unit of Measure Code:	P
Quantity Unit of Measure Description:	Pounds
Waste Quantity, in Tons:	0.75
Acute Waste Quantity, in Tons:	0
Non-Acute Waste Quantity, in Tons:	0.75
Waste Quantity, in Kilograms:	680.2725
Acute Waste Quantity, in Kilograms:	0
Non-Acute Waste Quantity, in Kilorgrams:	680.2725
Management Method Code:	H120
Management Method Description:	COMB. OF CHEMICAL, BIOLOGICAL, AND/OR PHYSICAL TRT
Waste Residue Indicator:	N
Quantity Discrepancy Indicator:	N
Waste Type Discrepancy Indicator:	N

NIAGARA MOHAWK - A NATIONAL GRID CO (Continued) **1026498246**

Waste Density:	Not reported
Waste Density Unit of Measure Code:	Not reported
Waste Density Unit of Measure Description:	Not reported
Form Code:	Not reported
Form Code Description:	Not reported
Source Code:	Not reported
Source Code Description:	Not reported
Waste Minimization Code:	Not reported
Waste Minimization Code Description:	Not reported
Consent Number:	Not reported
EPA Waste Indicator:	Y
Federal Waste Codes:	D008
Quantity Haz Kg:	680.2725
Quantity Haz Tons:	0.75
Quantity Non Haz Kg:	0
Quantity Non Haz Tons:	0
State Waste Codes:	Not reported

L65 **WAREHOUSE** **NY UST** **U004339826**
WSW **908 MONTGOMERY ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.186 mi.
982 ft. **Site 2 of 2 in cluster L**

Relative: **Lower**
Actual: **396 ft.**

UST:

Name:	WAREHOUSE
Address:	908 MONTGOMERY ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-991000 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	Not reported
UTM Y:	Not reported
Site Type:	Other Wholesale/Retail Sales

Affiliation Records:

Site Id:	615705
Affiliation Type:	Facility Owner
Company Name:	MORRISVILLE AUXILIARY CORP
Contact Type:	EXECUTIVE DIRECTOR
Contact Name:	JENNIFER BOWDEN
Address1:	PO BOX 901
Address2:	Not reported
City:	MORRISVILLE
State:	NY
Zip Code:	13408
Country Code:	001
Phone:	(315) 684-6048
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2021-01-14

Site Id:	615705
Affiliation Type:	Mail Contact
Company Name:	MORRISVILLE AUXILIARY CORP

WAREHOUSE (Continued) **U004339826**

Contact Type:	Not reported
Contact Name:	JENNIFER BOWDEN
Address1:	PO BOX 901
Address2:	Not reported
City:	MORRISVILLE
State:	NY
Zip Code:	13408
Country Code:	001
Phone:	(315) 684-6108
EMail:	BOWDENJJ@MORRISVILLE.EDU
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2021-01-14

Site Id:	615705
Affiliation Type:	Facility Operator
Company Name:	WAREHOUSE
Contact Type:	Not reported
Contact Name:	MORRISVILLE AUXILIARY CORP
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	Not reported
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2021-01-14

Site Id:	615705
Affiliation Type:	Emergency Contact
Company Name:	MORRISVILLE AUXILIARY CORP
Contact Type:	Not reported
Contact Name:	MORRISVILLE AUXILIARY CORP
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 684-6048
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KCKEMP
Date Last Modified:	2021-01-14

Tank Info:

Tank Number:	001
Tank ID:	289270
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	1000
Install Date:	Not reported
Date Tank Closed:	12/02/2020

WAREHOUSE (Continued) **U004339826**

Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Tightness Test Method:	-
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
K00 - Spill Prevention - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
E00 - Piping Secondary Containment - None
J00 - Dispenser - None
L00 - Piping Leak Detection - None
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None
B00 - Tank External Protection - None

Tank Number:	002
Tank ID:	289271
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	2000
Install Date:	Not reported
Date Tank Closed:	12/02/2020
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Tightness Test Method:	-
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
K00 - Spill Prevention - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
E00 - Piping Secondary Containment - None
J00 - Dispenser - None
L00 - Piping Leak Detection - None
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None
B00 - Tank External Protection - None

Tank Number:	003

WAREHOUSE (Continued) **U004339826**

Tank ID:	289272
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	2000
Install Date:	Not reported
Date Tank Closed:	12/02/2020
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Tightness Test Method:	-
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MJGRIFFI
Last Modified:	05/09/2022

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
K00 - Spill Prevention - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
E00 - Piping Secondary Containment - None
J00 - Dispenser - None
L00 - Piping Leak Detection - None
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None
B00 - Tank External Protection - None

M66 **NY1-1 PIONEER HOMES** **NY AST** **U003078218**
NW **ADAMS/RENWICK/TAYLOR/STATE** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.199 mi.
1050 ft. **Site 1 of 5 in cluster M**

Relative:
Lower

Actual:
396 ft.

AST:

Name:	NY1-1 PIONEER HOMES
Address:	ADAMS/RENWICK/TAYLOR/STATE
City,State,Zip:	SYRACUSE, NY 13202
Region:	STATE
DEC Region:	7
Site Status:	Unregulated/Closed
Facility Id:	7-498947
Program Type:	PBS
UTM X:	406600.05465
UTM Y:	4766007.99600
Expiration Date:	N/A
Site Type:	Apartment Building/Office Building

Affiliation Records:

Site Id:	46336
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE HOUSING AUTHORITY
Contact Type:	EXECUTIVE DIRECTOR
Contact Name:	WILLIAM SIMMONS
Address1:	516 BURT ST
Address2:	Not reported
City:	SYRACUSE

NY1-1 PIONEER HOMES (Continued) **U003078218**

State: NY
Zip Code: 13202
Country Code: 001
Phone: (315) 475-6181
EMail: Not reported
Fax Number: Not reported
Modified By: KCKEMP
Date Last Modified: 2011-01-14

Site Id: 46336
Affiliation Type: Mail Contact
Company Name: SYRACUSE HOUSING AUTHORITY
Contact Type: Not reported
Contact Name: ANDREW BARSUCH
Address1: 516 BURT ST
Address2: Not reported
City: SYRACUSE
State: NY
Zip Code: 13202
Country Code: 001
Phone: (315) 475-6181
EMail: ABARSUCH@SYRHOUSING.ORG
Fax Number: Not reported
Modified By: KCKEMP
Date Last Modified: 2011-01-14

Site Id: 46336
Affiliation Type: Facility Operator
Company Name: NY1-1 PIONEER HOMES
Contact Type: Not reported
Contact Name: GREG PALMER
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (315) 706-3727
EMail: Not reported
Fax Number: Not reported
Modified By: KCKEMP
Date Last Modified: 2011-01-14

Site Id: 46336
Affiliation Type: Emergency Contact
Company Name: SYRACUSE HOUSING AUTHORITY
Contact Type: Not reported
Contact Name: ANDREW BARSUCH
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (315) 439-4788
EMail: Not reported
Fax Number: Not reported

NY1-1 PIONEER HOMES (Continued) **U003078218**

Modified By: KCKEMP
Date Last Modified: 2011-01-14

Tank Info:

Tank Number: 001
Tank Id: 133567
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Equipment Records:

J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)
C01 - Pipe Location - Aboveground
F99 - Pipe External Protection - Other
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None

Tank Location: Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.
Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 12/01/1984
Capacity Gallons: 2500
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 11/22/2010
Register: True
Modified By: MJGRIFFI
Last Modified: 05/09/2022
Material Name: #2 fuel oil (on-site consumption)

Tank Number: 002
Tank Id: 133568
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Equipment Records:

J02 - Dispenser - Suction Dispenser
C01 - Pipe Location - Aboveground
F99 - Pipe External Protection - Other
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
B00 - Tank External Protection - None

Tank Location: Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.

NY1-1 PIONEER HOMES (Continued) **U003078218**

Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	12/01/1984
Capacity Gallons:	2500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	11/22/2010
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	#2 fuel oil (on-site consumption)

M67 **ADAMS & STATE ST. GARAGE** **NY LTANKS** **S105054364**
NW **ADAMS & STATE STREET** **N/A**
1/8-1/4 **SYRACUSE, NY**
0.202 mi.
1065 ft. **Site 2 of 5 in cluster M**

Relative: LTANKS:
Lower

Actual: Name:	ADAMS & STATE ST. GARAGE
396 ft. Address:	ADAMS & STATE STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9108385 / 1991-11-07
Facility ID:	9108385
Site ID:	210798
Spill Date:	1991-11-06
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	1991-11-07
SWIS:	3415
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1991-11-06
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1991-11-06
Spill Record Last Update:	1997-03-10
Spiller Name:	Not reported
Spiller Company:	ONONDAGA COUNTY
Spiller Address:	Not reported
Spiller County:	999
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	174767
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR

ADAMS & STATE ST. GARAGE (Continued) **S105054364**

11/07/91: EPS HIRED BY ONONDAGA COUNTY TO CLEAN AND REMOVE TANKS. 8 BARRELS OFWATER PUMPED FROM THE TWO TANKS FOR DISPOSAL. ALSO ONE BARREL OF SOIL. NO RESIDUAL CONTAMINATION REMAINING IN SOIL SURROUNDING TANKS.

Remarks: ONE TANK WAS DISCOVERED ON 11/05/91 AT 3:00. ON MORNING OF 11/06/91 THERE WAS ANOTHER TANK LOCATED WHICH WAS DAMAGED AND PRODUCT SPILLED.

All Materials:

Site ID:	210798
Operable Unit ID:	958676
Operable Unit:	01
Material ID:	420535
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

M68 **ADAMS & STATE ST. GARAGE** **UST FINDER RELEASE** **1029062545**
NW **ADAMS & STATE STREET** **N/A**
1/8-1/4 **SYRACUSE, NY 0**
0.202 mi.
1065 ft. **Site 3 of 5 in cluster M**

Relative: **Lower**

Actual: **396 ft.**

UST FINDER RELEASE:

Object ID:	249474
Facility ID:	NY174767
Lust ID:	NY9108385
Name:	ADAMS & STATE ST. GARAGE
Address:	ADAMS & STATE STREET
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1991/11/06 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1993
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported

ADAMS & STATE ST. GARAGE (Continued) **1029062545**

NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1475399999999
Y Coord:	43.04274
Latitude:	43.04274
Longitude:	-76.14754

N69 **NYSDOT BIN 7706370 - SYRACUSE BINGHAMTON & NEW YOR** **NY MANIFEST** **S119079300**
SE **522 RENWICK AVE** **N/A**
1/8-1/4 **SYRACUSE, NY 13210**
0.205 mi.
1085 ft. **Site 1 of 2 in cluster N**

Relative:
Higher

Actual:
427 ft.

NY MANIFEST:

EPA ID:	NYR000229765
Country:	USA
Name:	Nysdot Bin 7706370 - Syracuse Binghamton & New York Railroad Corp
Address:	522 RENWICK AVE
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13210
Zip 4:	Not reported
Location Address 1:	522 RENWICK AVE
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13210
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Nysdot Bin 7706370 - Syracuse Binghamton & New York Railroad Corp
Mailing Contact:	Rick Howard
Mailing Address 1:	1 RAILROAD AVE
Mailing Address 2:	Not reported
Mailing City,State,Zip:	COOPERSTOWN, NY 13326
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	6072016049

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJR986628162
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	11/29/2016
Trans1 Recv Date:	11/29/2016
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/29/2016
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000229765
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD991291105
TSDF ID 2:	Not reported

NYSDOT BIN 7706370 - SYRACUSE BINGHAMTON & NEW YORK RAILROAD (Continued) **S119079300**

Manifest Tracking Number:	009401721FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code a:	Lead
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	500
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	1

N70 **NYSDOT BIN 7706370 - SYRACUSE BINGHAMTON & NEW YOR** **RCRA NonGen / NLR** **1019909605**
SE **522 RENWICK AVE** **FINDS** **NYR000229765**
1/8-1/4 **SYRACUSE, NY 13210** **ECHO**
0.205 mi.
1085 ft. **Site 2 of 2 in cluster N**

Relative: **Higher**
Actual: **427 ft.**

RCRA Listings:

Date Form Received by Agency:	20170418
Handler Name:	Nysdot Bin 7706370 - Syracuse Binghamton & New York Railroad Corp
Handler Address:	Renwick Ave
Handler City,State,Zip:	SYRACUSE, NY 13210
EPA ID:	NYR000229765
Contact Name:	RICHARD M HOWARD
Contact Address:	RAILROAD AVE
Contact City,State,Zip:	COOPERSTOWN, NY 13326
Contact Telephone:	607-547-2555 x222
Contact Fax:	607-547-2555
Contact Email:	RHOWARD@NYSW.COM
Contact Title:	ASSISTANT CHIEF ENGINEER
EPA Region:	02
Land Type:	County
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported

NYSDOT BIN 7706370 - SYRACUSE BINGHAMTON & NEW YORK RAILROAD (Continued) **1019909605**

State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	RAILROAD AVE
Mailing City,State,Zip:	COOPERSTOWN, NY 13326
Owner Name:	Onondaga County Industrial Development
Owner Type:	County
Operator Name:	Syracuse Binghamton & New York Railroad
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20170530
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D008
Waste Description:	Lead

Handler - Owner Operator:

Owner/Operator Indicator:	Owner

NYSDOT BIN 7706370 - SYRACUSE BINGHAMTON & NEW YORK RAILROAD (Continued) **1019909605**

Owner/Operator Name: ONONDAGA COUNTY INDUSTRIAL DEVELOPMENT
Legal Status: County
Date Became Current: 19930505
Date Ended Current: Not reported
Owner/Operator Address: 333 W WASHINGTON ST SUITE 130
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-435-3770
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: ONONDAGA COUNTY INDUSTRIAL DEVELOPMENT
Legal Status: County
Date Became Current: 19930505
Date Ended Current: Not reported
Owner/Operator Address: 333 W WASHINGTON ST SUITE 130
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-435-3770
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SYRACUSE BINGHAMTON & NEW YORK RAILROAD
Legal Status: Private
Date Became Current: 19930505
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SYRACUSE BINGHAMTON & NEW YORK RAILROAD
Legal Status: Private
Date Became Current: 19930505
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20170418
Handler Name: NYSDOT BIN 7706370 - SYRACUSE BINGHAMTON & NEW YORK RAILROAD CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No

NYSDOT BIN 7706370 - SYRACUSE BINGHAMTON & NEW YORK RAILROAD (Continued) **1019909605**

Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20161114
Handler Name: NYSDOT BIN 7706370 - SYRACUSE BINGHAMTON & NEW YORK RAILROAD CORP
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 482112
NAICS Description: Short Line Railroads

NAICS Code: 488210
NAICS Description: Support Activities For Rail Transportation

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110070122138

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1019909605
Registry ID: 110070122138

DFR URL:
Name: NYSDOT BIN 7706370 - SYRACUSE BINGHAMTON & NEW YORK RAILROAD CORP
Address: 522 RENWICK AVE
City,State,Zip: SYRACUSE, NY 13210

71
NE
1/8-1/4
0.215 mi.
1137 ft.

SUNY HEALTH SCIENCE CENTER
SYRACUSE, NY

PFAS ECHO

1031421415
N/A

Relative:
Higher

Actual:
410 ft.

PFAS ECHO:

Facility ID:	110041374875
Name:	Suny Health Science Center
Address:	Not reported
City,State,Zip:	SYRACUSE, NY
Latitude:	43.042
Longitude:	-76.1405
Count:	1
County:	ONONDAGA
Status:	Unknown
Region:	02
Industry:	Airports

ECHO Facility Report:

Facility Percent Minority:	45.728
Facility Derived Tribes:	Onondaga Nation - 5 mile(s), Oneida Indian Nation - 9 mile(s)
Facility Population:	5394.42
EPA Programs:	-
Federal Facility:	No
Federal Agency:	-
Facility FIPS Code:	36067
Facility Indian Country Flag:	N
Facility Collection Method:	-
Facility Derived HUC:	04140201
Facility Derived WBD:	041402011507
Facility Derived CD113:	24
Facility Derived CB2010:	360670043011001
Facility Major Flag:	-
Facility Active Flag:	-
Facility Inspection Count:	0
Facility Date Last Inspection:	-
Facility Days Last Inspection:	-
Facility Informal Count:	0
Facility Date Last Informal Action:	-
Facility Formal Action Count:	0
Facility Date Last Formal Action:	-
Facility Total Penalties:	0
Facility Penalty Count:	-
Facility Date Last Penalty:	-
Facility Last Penalty AMT:	-
Facility QTRS With NC:	-
Facility Programs With SNC:	0
Facility Compliance Status:	-
Facility SNC Flag:	N
AIR Flag:	N
NPDES Flag:	N
SDWIS Flag:	N
RCRA Flag:	N
TRI Flag:	N
GHG Flag:	N
AIR IDS:	-
CAA Permit Types:	-
CAA NAICS:	-

SUNY HEALTH SCIENCE CENTER (Continued) **1031421415**

CAA SICS:	-
NPDES IDS:	-
CWA Permit Types:	-
CWA NAICS:	-
CWA SICS:	-
RCRA IDS:	-
RCRA Permit Types:	-
RCRA NAICS:	-
SDWA IDS:	-
SDWA System Types:	-
SDWA Compliance Status:	-
SDWA SNC Flag:	N
TRI IDS:	-
TRI Releases Transfers:	-
TRI On Site Releases:	-
TRI Off Site Transfers:	-
TRI Reporter:	-
Facility IMP Water Flag:	-

---

72 **SYRACUSE UNIVERSITY - BREWSTER/BOLAND** **RCRA NonGen / NLR** **1000552352**
SE **401 VAN BUREN ST** **FINDS** **NYD986947505**
1/8-1/4 **SYRACUSE, NY 13244** **ECHO**
0.217 mi. **E MANIFEST**
1146 ft. **NY MANIFEST**

Relative: **Higher**

Actual: **452 ft.**

RCRA Listings:

Date Form Received by Agency:	20180501
Handler Name:	Syracuse University - Brewster/Boland
Handler Address:	Van Buren St
Handler City,State,Zip:	SYRACUSE, NY 13244
EPA ID:	NYD986947505
Contact Name:	DANIEL G KLACZANY
Contact Address:	LYMAN HALL
Contact City,State,Zip:	SYRACUSE, NY 13244-1270
Contact Telephone:	315-443-9132
Contact Fax:	Not reported
Contact Email:	DGKLACZA@SYR.EDU
Contact Title:	Not reported
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	LYMAN HALL
Mailing City,State,Zip:	SYRACUSE, NY 13244-1270
Owner Name:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No

SYRACUSE UNIVERSITY - BREWSTER/BOLAND (Continued) **1000552352**

Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20180501
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	NONE
Waste Description:	Not Defined
Waste Code:	X002
Waste Description:	Not Defined

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	SYRACUSE UNIV BOARD OF TRUSTEES
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	TOLLEY ADMIN BLDG
Owner/Operator City,State,Zip:	SYRACUSE, NY 13244
Owner/Operator Telephone:	315-443-4132

SYRACUSE UNIVERSITY - BREWSTER/BOLAND (Continued) **1000552352**

Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SYRACUSE UNIVERSITY BOARD OF TRUSTEES
Legal Status: Private
Date Became Current: 19660901
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE UNIVERSITY BOARD OF TRUSTEES
Legal Status: Private
Date Became Current: 19470415
Date Ended Current: Not reported
Owner/Operator Address: CROUSE-HINDS HALL
Owner/Operator City,State,Zip: SYRACUSE, NY 13244-1270
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20180501
Handler Name: SYRACUSE UNIVERSITY - BREWSTER/BOLAND
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 19911025
Handler Name: SYRACUSE UNIVERSITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: SYRACUSE UNIVERSITY

SYRACUSE UNIVERSITY - BREWSTER/BOLAND (Continued) **1000552352**

Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070603
Handler Name: SYRACUSE UNIVERSITY - BREWSTER/BOLAND
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19910410
Handler Name: SYRACUSE UNIVERSITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070604
Handler Name: SYRACUSE UNIVERSITY - BREWSTER/BOLAND
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 61131
NAICS Description: Colleges, Universities, And Professional Schools

Facility Has Received Notices of Violations:
Violations: No Violations Found

SYRACUSE UNIVERSITY - BREWSTER/BOLAND (Continued) **1000552352**

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110004464268

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1000552352
Registry ID: 110004464268

DFR URL:
Name: SYRACUSE UNIVERSITY - BREWSTER/BOLAND
Address: 401 VAN BUREN ST
City,State,Zip: SYRACUSE, NY 13244

E MANIFEST:

Manifest Tracking Number:	001016443VES
Last Updated Date:	20180917
Shipped Date:	20180801
Received Date:	20180810
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYCESQG
Generator Name:	Syracuse University-(Brockway)
Generator Location Street Number:	Not reported
Generator Location Street 1:	401 VAN BUREN STREET
Generator Location Street 2:	BREWSTER/BOLAND/BROCKWAY HALLS
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13210-0000
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	C/O EHSS (DAN KLACZANY)
Generator Mail Street 2:	100 COLLEGE PLACE
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13210-0000
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD980536593
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	1
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	1 EDEN LANE

SYRACUSE UNIVERSITY - BREWSTER/BOLAND (Continued) **1000552352**

Designated Facility Mail City: FLANDERS
Designated Facility Mail Zip: 07836
Designated Facility Mail State: NJ
Designated Facility Location Street Number: 1
Designated Facility Location Street 1: 1 EDEN LANE
Designated Facility Location Street 2: Not reported
Designated Facility Location City: FLANDERS
Designated Facility Location Zip: 07836
Designated Facility Location State: NJ
Designated Facility Contact Company Name: Veolia Es Technical Solutions Llc
Manifest Residue Indicator: N
Rejection Indicator: N

Transporter:
Manifest Tracking Number: 001016443VES
Transporter Line Number: 1
Transporter EPA ID: NJD080631369
Transporter Name: Veolia Es Technical Solutions

Manifest Tracking Number: 001016443VES
Transporter Line Number: 2
Transporter EPA ID: NJD054126164
Transporter Name: Freehold Cartage Inc

Manifest Tracking Number: 001016443VES
Transporter Line Number: 3
Transporter EPA ID: NJD080631369
Transporter Name: Veolia Es Technical Solutions

Manifest Tracking Number: 001016443VES
Transporter Line Number: 4
Transporter EPA ID: NJD054126164
Transporter Name: Freehold Cartage Inc

Waste Line:
Manifest Tracking Number: 001016443VES
Waste Line Number: 1
U.S. DOT Hazardous Indicator: Y
U.S. DOT ID Number: UN3432
U.S. DOT Description: Un3432, Waste Polychlorinated Biphenyls, Solid, (Debris >50-Ppm Pcb'S: Caulk, Poly, Ppe, Concrete), 9, Ii, Rq (1-Lb/ Pcb'S/ B007)
Non-Hazardous Waste Description: Not reported
Number of Containers: 1
Container Type Code: CF
Container Type Description: Fiber or plastic boxes, cartons, cases
Waste Quantity: 97
Quantity Unit of Measure Code: K
Quantity Unit of Measure Description: Kilograms
Waste Quantity, in Tons: 0.10694244
Acute Waste Quantity, in Tons: 0
Non-Acute Waste Quantity, in Tons: 0.10694244
Waste Quantity, in Kilograms: 97
Acute Waste Quantity, in Kilograms: 0
Non-Acute Waste Quantity, in Kilorgrams: 97
Management Method Code: H141
Management Method Description: STORAGE, BULKING AND/OR TRANSFER OFF SITE

SYRACUSE UNIVERSITY - BREWSTER/BOLAND (Continued) **1000552352**

Waste Residue Indicator:	N
Quantity Discrepancy Indicator:	N
Waste Type Discrepancy Indicator:	N
Waste Density:	Not reported
Waste Density Unit of Measure Code:	Not reported
Waste Density Unit of Measure Description:	Not reported
Form Code:	Not reported
Form Code Description:	Not reported
Source Code:	Not reported
Source Code Description:	Not reported
Waste Minimization Code:	Not reported
Waste Minimization Code Description:	Not reported
Consent Number:	Not reported
EPA Waste Indicator:	N
Federal Waste Codes:	Not reported
Quantity Haz Kg:	0
Quantity Haz Tons:	0
Quantity Non Haz Kg:	97
Quantity Non Haz Tons:	0.10694244
State Waste Codes:	NJ-ID27, NY-B, NY-B007
Manifest Tracking Number:	001016443VES
Waste Line Number:	2
U.S. DOT Hazardous Indicator:	Y
U.S. DOT ID Number:	UN3432
U.S. DOT Description:	Un3432, Waste Polychlorinated Biphenyls, Solid, (Debris >50-Ppm Pcb'S: Caulk, Poly, Ppe, Concrete), 9, Ii, Rq (1lb/ Pcb'S/ B007)
Non-Hazardous Waste Description:	Not reported
Number of Containers:	1
Container Type Code:	CF
Container Type Description:	Fiber or plastic boxes, cartons, cases
Waste Quantity:	96
Quantity Unit of Measure Code:	K
Quantity Unit of Measure Description:	Kilograms
Waste Quantity, in Tons:	0.10583994
Acute Waste Quantity, in Tons:	0
Non-Acute Waste Quantity, in Tons:	0.10583994
Waste Quantity, in Kilograms:	96
Acute Waste Quantity, in Kilograms:	0
Non-Acute Waste Quantity, in Kilorgrams:	96
Management Method Code:	H141
Management Method Description:	STORAGE, BULKING AND/OR TRANSFER OFF SITE
Waste Residue Indicator:	N
Quantity Discrepancy Indicator:	N
Waste Type Discrepancy Indicator:	N
Waste Density:	Not reported
Waste Density Unit of Measure Code:	Not reported
Waste Density Unit of Measure Description:	Not reported
Form Code:	Not reported
Form Code Description:	Not reported
Source Code:	Not reported
Source Code Description:	Not reported
Waste Minimization Code:	Not reported
Waste Minimization Code Description:	Not reported
Consent Number:	Not reported
EPA Waste Indicator:	N
Federal Waste Codes:	Not reported

SYRACUSE UNIVERSITY - BREWSTER/BOLAND (Continued) **1000552352**

Quantity Haz Kg:	0
Quantity Haz Tons:	0
Quantity Non Haz Kg:	96
Quantity Non Haz Tons:	0.10583994
State Waste Codes:	NJ-ID27, NY-B, NY-B007

NY MANIFEST:

EPA ID:	NYD986947505
Country:	USA
Name:	Syracuse University
Address:	401 VAN BUREN ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13244
Zip 4:	Not reported
Location Address 1:	401 VAN BUREN ST
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13244
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Syracuse University
Mailing Contact:	Syracuse University
Mailing Address 1:	108 COLLEGE PL BREWSTER BOLAND
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13244
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154434132

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD080631369
Year:	2018
Trans2 State ID:	NJD054126164
Generator Ship Date:	05/12/2011
Trans1 Recv Date:	05/12/2011
Trans2 Recv Date:	05/24/2011
TSD Site Recv Date:	05/25/2011
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986947505
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD980536593
TSDF ID 2:	Not reported
Manifest Tracking Number:	000521519VES
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N

SYRACUSE UNIVERSITY - BREWSTER/BOLAND (Continued) **1000552352**

Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Not reported
Waste Code b:	B007
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	10
Units:	Kilograms
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD080631369
Year:	2018
Trans2 State ID:	NMD002208627
Generator Ship Date:	06/28/2007
Trans1 Recv Date:	06/28/2007
Trans2 Recv Date:	07/02/2007
TSD Site Recv Date:	07/06/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986947505
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD980536593
TSDF ID 2:	Not reported
Manifest Tracking Number:	000022147VES
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Not reported
Waste Code b:	B007
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported

SYRACUSE UNIVERSITY - BREWSTER/BOLAND (Continued) **1000552352**

Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	10
Units:	Kilograms
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD080631369
Year:	2018
Trans2 State ID:	NJD080631369
Generator Ship Date:	06/06/2007
Trans1 Recv Date:	06/06/2007
Trans2 Recv Date:	06/08/2007
TSD Site Recv Date:	06/08/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986947505
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD980536593
TSDF ID 2:	Not reported
Manifest Tracking Number:	000021655VES
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Not reported
Waste Code b:	B007
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	571
Units:	Kilograms
Number of Containers:	6
Container Type:	Metal drums, barrels, kegs

SYRACUSE UNIVERSITY - BREWSTER/BOLAND (Continued) **1000552352**

Handling Method:	Burn
Specific Gravity:	1
Document ID:	NYB2605401
Manifest Status:	Not reported
Trans1 State ID:	DT09844CA
Year:	1991
Trans2 State ID:	Not reported
Generator Ship Date:	05/09/1991
Trans1 Recv Date:	05/09/1991
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/14/1991
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986947505
Trans1 EPA ID:	MOD095038998
Trans2 EPA ID:	Not reported
TSDF ID 1:	KSD980964993
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	B006
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	02793
Units:	Kilograms
Number of Containers:	001
Container Type:	Metal boxes, cartons, cases (including roll-offs)
Handling Method:	Landfill
Specific Gravity:	01.00
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NJD080631369
Year:	2018
Trans2 State ID:	NJD054126164
Generator Ship Date:	10/22/2015
Trans1 Recv Date:	10/22/2015
Trans2 Recv Date:	10/29/2015
TSD Site Recv Date:	11/02/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986947505
Trans1 EPA ID:	Not reported

SYRACUSE UNIVERSITY - BREWSTER/BOLAND (Continued) **1000552352**

Trans2 EPA ID: Not reported
TSDF ID 1: OHD093945293
TSDF ID 2: Not reported
Manifest Tracking Number: 000616657VES
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H061
Waste Code a: Ignitable Waste
Waste Code b: Not reported
Waste Code c: Not reported
Waste Code e: Not reported
Waste Code f: Not reported
Waste Code g: Not reported
Waste Code 1: Not reported
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 199
Units: Pounds
Number of Containers: 2
Container Type: Metal drums, barrels, kegs
Handling Method: Burn
Specific Gravity: 1

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD080631369
Year: 2018
Trans2 State ID: NJD054126164
Generator Ship Date: 07/18/2014
Trans1 Recv Date: 07/18/2014
Trans2 Recv Date: 07/25/2014
TSD Site Recv Date: 07/29/2014
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986947505
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: OHD093945293
TSDF ID 2: Not reported
Manifest Tracking Number: 000609367VES
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N

SYRACUSE UNIVERSITY - BREWSTER/BOLAND (Continued) **1000552352**

Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H061
Waste Code a:	Lead
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	144
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1

O73 **SOUTH SALINA SIDA** **NY SHWS** **S113916746**
SW **1016-1018 MONTGOMERY ST.** **N/A**
1/8-1/4 **SYRACUSE, NY 13204**
0.220 mi.
1162 ft. **Site 1 of 3 in cluster O**

Relative: **Lower**
Actual: **392 ft.**

SHWS:

Name:	SOUTH SALINA SIDA
Address:	1016-1018 MONTGOMERY ST.
City,State,Zip:	SYRACUSE, NY 13204
Program:	HW
Site Code:	422215
Classification:	N
Region:	7
Acres:	Not reported
HW Code:	734120
Record Add:	11/25/2009
Record Upd:	02/19/2010
Updated By:	BRWOLOSE
Site Description:	"Description Not Available"
Env Problem:	""
Health Problem:	Not reported
Dump:	Not reported
Structure:	Not reported
Lagoon:	Not reported
Landfill:	Not reported
Pond:	Not reported
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	Not reported
Record Upd:	Not reported

SOUTH SALINA SIDA (Continued) **S113916746**

Updated By:	Not reported
Own Op:	1
Sub Type:	C01
Owner Name:	Not reported
Owner Company:	Syracuse Industrial Development Agency
Owner Address:	201 E. Washington Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	Not reported
Cross Ref Type Code:	Not reported
Cross Ref Type:	Not reported
Record Added Date:	Not reported
Record Updated:	Not reported
Updated By:	Not reported

P74 **FAMILY DOLLAR #5071** **NY MANIFEST** **S118708542**
WSW **945 S SALINA ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.228 mi.
1202 ft. **Site 1 of 3 in cluster P**

Relative: **Lower**
Actual: **396 ft.**

NY MANIFEST:

EPA ID:	NYR000211730
Country:	USA
Name:	Family Dollar #5071
Address:	945 S SALINA ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	945 S SALINA ST
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Family Dollar #5071
Mailing Contact:	Family Dollar #5071
Mailing Address 1:	945 S SALINA ST
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	Not reported

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD982661381
Year:	2018
Trans2 State ID:	NJR000063677

FAMILY DOLLAR #5071 (Continued) **S118708542**

Generator Ship Date:	05/17/2016
Trans1 Recv Date:	05/17/2016
Trans2 Recv Date:	05/24/2016
TSD Site Recv Date:	05/25/2016
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000211730
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	RID040098352
TSDF ID 2:	Not reported
Manifest Tracking Number:	009248480FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Ignitable Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	13
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD982661381
Year:	2018
Trans2 State ID:	NJR000063677
Generator Ship Date:	05/17/2016
Trans1 Recv Date:	05/17/2016
Trans2 Recv Date:	05/24/2016
TSD Site Recv Date:	05/25/2016
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000211730
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	RID040098352

FAMILY DOLLAR #5071 (Continued) **S118708542**

TSDF ID 2:	Not reported
Manifest Tracking Number:	009248480FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Ignitable Waste
Waste Code b:	Methyl Ethyl Ketone
Waste Code c:	2-Propanone (I) (Or) Acetone (I)
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	3
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	PAD982661381
Year:	2018
Trans2 State ID:	NJR000063677
Generator Ship Date:	05/17/2016
Trans1 Recv Date:	05/17/2016
Trans2 Recv Date:	05/24/2016
TSD Site Recv Date:	05/25/2016
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000211730
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	RID040098352
TSDF ID 2:	Not reported
Manifest Tracking Number:	009248480FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported

FAMILY DOLLAR #5071 (Continued) **S118708542**

Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Not reported
Waste Code b:	Corrosive Waste
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	10
Units:	Pounds
Number of Containers:	1
Container Type:	Burlap, cloth, paper or plastic bags
Handling Method:	Treat
Specific Gravity:	1

P75 **FAMILY DOLLAR #5071** **RCRA-VSQG 1016974714**
WSW **945 S SALINA ST** **ECHO NYR000211730**
1/8-1/4 **SYRACUSE, NY 13202**
0.228 mi.
1202 ft. **Site 2 of 3 in cluster P**

Relative: **Lower**
Actual: **396 ft.**

RCRA Listings:

Date Form Received by Agency:	20140806
Handler Name:	Family Dollar #5071
Handler Address:	S Salina St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYR000211730
Contact Name:	KEVIN STRAIGHT
Contact Address:	PO BOX 1017
Contact City,State,Zip:	CHARLOTTE, NC 28201
Contact Telephone:	704-708-1909
Contact Fax:	Not reported
Contact Email:	KSTRAIGHT@FAMILYDOLLAR.COM
Contact Title:	PROGRAM MANAGER ENVIRONMENTAL COMPLIANCE
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	PO BOX 1017
Mailing City,State,Zip:	CHARLOTTE, NC 28201
Owner Name:	Family Dollar Stores
Owner Type:	Private
Operator Name:	Family Dollar Stores
Operator Type:	Private
Short-Term Generator Activity:	No

FAMILY DOLLAR #5071 (Continued) **1016974714**

Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20151218
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	D004
Waste Description:	Arsenic
Waste Code:	D005
Waste Description:	Barium
Waste Code:	D007
Waste Description:	Chromium
Waste Code:	D008
Waste Description:	Lead

FAMILY DOLLAR #5071 (Continued) **1016974714**

Waste Code: D009
Waste Description: Mercury

Waste Code: D010
Waste Description: Selenium

Waste Code: D011
Waste Description: Silver

Waste Code: D016
Waste Description: 2,4-D (2,4-Dichlorophenoxyacetic Acid)

Waste Code: D024
Waste Description: M-Cresol

Waste Code: D035
Waste Description: Methyl Ethyl Ketone

Waste Code: U002
Waste Description: 2-Propanone (I) (Or) Acetone (I)

Handler - Owner Operator:
Owner/Operator Indicator: Owner
Owner/Operator Name: FAMILY DOLLAR STORES
Legal Status: Private
Date Became Current: 20020516
Date Ended Current: Not reported
Owner/Operator Address: 10301 MONROE RD
Owner/Operator City,State,Zip: MATTHEWS, NC 28105
Owner/Operator Telephone: 866-377-6420
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: FAMILY DOLLAR STORES
Legal Status: Private
Date Became Current: 20020516
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20140806
Handler Name: FAMILY DOLLAR #5071
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No

FAMILY DOLLAR #5071 (Continued) **1016974714**

Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 45299
NAICS Description: All Other General Merchandise Stores

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

ECHO:
Envid: 1016974714
Registry ID: 110060282493

DFR URL:
Name: FAMILY DOLLAR #5071
Address: 945 S SALINA ST
City,State,Zip: SYRACUSE, NY 13202

M76 **CENTRAL TECH** **UST FINDER** **1028589651**
NW **285 E. ADAMS ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.229 mi.
1207 ft. **Site 4 of 5 in cluster M**

Relative:
Lower

Actual:
395 ft.

UST FINDER:
Object ID: 318285
Facility ID: NY45851
Name: CENTRAL TECH
Address: 285 E. ADAMS ST
City,State,Zip: SYRACUSE, NY 13202
Address Match Type: Not reported
Open USTs: 0
Closed USTs: 1
TOS USTs: 0
Population 1500ft: 1389
Private Wells 1500ft: 0
Within 100yr Floodplain: No
Land Use: Developed, High Intensity
Within SPA: No
SPA PWS Facility ID: Not reported
SPA Water Type: Not reported
SPA Facility Type: Not reported
SPA HUC12: Not reported
Within WHPA: No
WHPA PWS Facility ID: Not reported
WHPA Water Type: Not reported
WHPA Facility Type: Not reported
WHPA HUC12: Not reported
Facility Status: Closed UST(s)

CENTRAL TECH (Continued) **1028589651**

Date of Last Inspection:	Not reported
EPA Region:	2
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-76.149154
Y Coord:	43.0427750000001
Latitude:	43.042775
Longitude:	-76.149154

UST FINDER:

Object ID:	1281404
Facility ID:	NY45851
Tank ID:	NY72970
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	Not reported
Tank Capacity:	10000
Substances:	Not reported
Tank Wall Type:	Not reported

77
North
1/8-1/4
0.234 mi.
1237 ft.

CENTRO PARKING INC. **NY LTANKS** **S100782289**
SUNY HEALTH SRV. CENTER **N/A**
SYRACUSE, NY

Relative:
Lower

Actual:
398 ft.

LTANKS:

Name:	CENTRO PARKING INC.
Address:	SUNY HEALTH SRV. CENTER
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9311487 / 2001-02-12
Facility ID:	9311487
Site ID:	323404
Spill Date:	1993-12-23
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1993-12-23
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1993-12-31
Spill Record Last Update:	2001-02-12
Spiller Name:	Not reported
Spiller Company:	NYS DORMITORY
Spiller Address:	161 DELAWARE AVE
Spiller County:	001
Spiller Contact:	Not reported

CENTRO PARKING INC. (Continued) **S100782289**

Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	260522
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM 12/27/93: SPOKE W/ MIKE,ONFORMED HIM TO PUMP DOWN TANKS AND TO CONTACT HOWARD FOR PROPER CLOSURE OF THE TANK. 09/28/95: This is additional information about material spilled from the translation of the old spill file: TANK FAILURE.
Remarks:	TANKS WAS TESTED JAN 93 OK;NOW APPEARS TO BE TAKING ON WATER. CALLER TO INVEST WITH POSSIBLE CONTRACTOR.

All Materials:

Site ID:	323404
Operable Unit ID:	993371
Operable Unit:	01
Material ID:	390524
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Q78 **INSTITUTE OF TECHNOLOGY** **RCRA NonGen / NLR** **1000705550**
NW **258 E ADAMS ST** **NY MANIFEST** **NYD986981520**
1/8-1/4 **SYRACUSE, NY 13210**
0.236 mi.
1248 ft. **Site 1 of 3 in cluster Q**

Relative: **Lower**
Actual: **395 ft.**

RCRA Listings:

Date Form Received by Agency:	20150626
Handler Name:	Institute Of Technology
Handler Address:	E Adams St
Handler City,State,Zip:	SYRACUSE, NY 13210
EPA ID:	NYD986981520
Contact Name:	RICHARD L LAW
Contact Address:	SCHUYLER RD
Contact City,State,Zip:	EAST SYRACUSE, NY 13057
Contact Telephone:	315-437-5906 x1
Contact Fax:	315-437-3650
Contact Email:	RLAW@RHLAWINC.COM
Contact Title:	PRESIDENT - ROBERT H LAW INC
EPA Region:	02
Land Type:	District
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Mailing Address:		E ADAMS ST
Mailing City,State,Zip:		SYRACUSE, NY 13210
Owner Name:	City Of Syracuse Central	
Owner Type:		District
Operator Name:	Sharon L Contreras	
Operator Type:		District
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
202 GPRA Corrective Action Baseline:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No
Addressed Significant Non-Complier Universe:		No
Significant Non-Complier With a Compliance Schedule Universe:		No
Financial Assurance Required:		Not reported
Handler Date of Last Change:		20150626
Recognized Trader-Importer:		No
Recognized Trader-Exporter:		No
Importer of Spent Lead Acid Batteries:		No
Exporter of Spent Lead Acid Batteries:		No
Recycler Activity Without Storage:		No
Manifest Broker:		No
Sub-Part P Indicator:		No

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	D008
Waste Description:	Lead

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Waste Code: D009
Waste Description: Mercury

Handler - Owner Operator:
Owner/Operator Indicator: Operator
Owner/Operator Name: SHARON L CONTRERAS
Legal Status: District
Date Became Current: 20110701
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SYRACUSE CITY SCHOOL DIST
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 725 HARRISON ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-435-4292
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SHARON L CONTRERAS
Legal Status: District
Date Became Current: 20110701
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE CITY SCHOOL DIST
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 725 HARRISON ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-435-4292
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: CITY OF SYRACUSE CENTRAL
Legal Status: District
Date Became Current: 19570101
Date Ended Current: Not reported

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Owner/Operator Address: 725 HARRISON ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-435-4499
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: CITY OF SYRACUSE CENTRAL
Legal Status: District
Date Became Current: 19570101
Date Ended Current: Not reported
Owner/Operator Address: 725 HARRISON ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-435-4499
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SYRACUSE CITY SCHOOL DIST
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 725 HARRISON ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-435-4292
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20060101
Handler Name: SYRACUSE CITY SCH DIST - CENTRAL TECH
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: SYRACUSE CITY SCH DIST - CENTRAL TECH
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150626
Handler Name: INSTITUTE OF TECHNOLOGY
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19960229
Handler Name: SYRACUSE CITY SCH DIST - CENTRAL TECH
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20131226
Handler Name: INSTITUTE OF TECHNOLOGY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 611110
NAICS Description: Elementary And Secondary Schools

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

NY MANIFEST:
EPA ID: NYD986981520

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Country:	USA
Name:	Central Tech School
Address:	258 E ADAMS ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	258 EAST ADAMS STREET
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13210
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Central Tech School
Mailing Contact:	Nick Dibello
Mailing Address 1:	258 EAST ADAMS STREET
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154354292

Manifest Data:

Document ID:	MAM9877680
Manifest Status:	Not reported
Trans1 State ID:	NYLJ5601
Year:	2001
Trans2 State ID:	3944
Generator Ship Date:	10/17/2001
Trans1 Recv Date:	10/17/2001
Trans2 Recv Date:	10/18/2001
TSD Site Recv Date:	10/24/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	SCR000075150
Trans2 EPA ID:	MOD095038898
TSDF ID 1:	MAD982755639
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Silver
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00045
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Document ID:	NYC6172773
Manifest Status:	Not reported
Trans1 State ID:	NYNF6376
Year:	2000
Trans2 State ID:	Not reported
Generator Ship Date:	06/14/2000
Trans1 Recv Date:	06/14/2000
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/15/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	SCR000075150
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00017
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	Tetrachloroethylene
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Container Type: Fiberboard or plastic drums, barrels, kegs
Handling Method: Treat
Specific Gravity: 01.00

Document ID: NYC5537632
Manifest Status: Not reported
Trans1 State ID: NYNF6576
Year: 1999
Trans2 State ID: Not reported
Generator Ship Date: 03/22/1999
Trans1 Recv Date: 03/22/1999
Trans2 Recv Date: Not reported
TSD Site Recv Date: 03/23/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986981520
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID 1: NYD982743312
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: Tetrachloroethylene
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00005
Units: Gallons (liquids only)
Number of Containers: 001
Container Type: Fiberboard or plastic drums, barrels, kegs
Handling Method: Treat
Specific Gravity: 01.00

Document ID: NYC7555061
Manifest Status: Not reported
Trans1 State ID: NY16607JJ
Year: 2005
Trans2 State ID: Not reported
Generator Ship Date: 01/20/2005
Trans1 Recv Date: 01/20/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 01/21/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986981520

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Trans1 EPA ID:	TXR000050930
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Tetrachloroethylene
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00034
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Waste Code 7:	Tetrachloroethylene
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	06/19/2008
Trans1 Recv Date:	06/19/2008
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/19/2008
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	000745823SKS

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Tetrachloroethylene
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/24/2006
Trans1 Recv Date:	02/24/2006
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/24/2006
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	NYC7660675
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

MGMT Method Type Code:	Not reported
Waste Code a:	Tetrachloroethylene
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	30
Units:	Gallons (liquids only)
Number of Containers:	2
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	0.8

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/24/2006
Trans1 Recv Date:	02/24/2006
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/24/2006
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	NYC7660675
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code a:	Tetrachloroethylene
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/24/2006
Trans1 Recv Date:	02/24/2006
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/24/2006
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	NYC7660675
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code a:	Ignitable Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	15
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	1

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/22/2008
Trans1 Recv Date:	02/22/2008
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/22/2008
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	000745540SKS
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Ignitable Waste
Waste Code b:	Benzene
Waste Code c:	Tetrachloroethylene
Waste Code e:	Trichlorethylene
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	15
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/22/2008
Trans1 Recv Date:	02/22/2008
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/22/2008
Part A Recv Date:	Not reported

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	000745540SKS
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Tetrachloroethylene
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	30
Units:	Gallons (liquids only)
Number of Containers:	2
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	TXR000050930
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/22/2008
Trans1 Recv Date:	02/22/2008
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/22/2008
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986981520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	000745540SKS
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N

INSTITUTE OF TECHNOLOGY (Continued) **1000705550**

Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Tetrachloroethylene
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	1

Click this hyperlink while viewing on your computer to access
63 additional NY MANIFEST: record(s) in the EDR Site Report.

Q79
NW
1/8-1/4
0.236 mi.
1248 ft.

CENTRAL TECH VOCATIONAL SCHOOL **NY UST** **U003313663**
258 EAST ADAMS ST **N/A**
SYRACUSE, NY 13202

Site 2 of 3 in cluster Q

Relative:
Lower

Actual:
395 ft.

UST:

Name:	CENTRAL TECH VOCATIONAL SCHOOL
Address:	258 EAST ADAMS ST
City,State,Zip:	SYRACUSE, NY 13202
Id/Status:	7-430617 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	7
Expiration Date:	N/A
UTM X:	406367.05197
UTM Y:	4766129.62140
Site Type:	School

Affiliation Records:

Site Id:	45851
Affiliation Type:	Emergency Contact
Company Name:	SYRACUSE CITY SCHOOL DISTRICT
Contact Type:	Not reported
Contact Name:	CARL VERZILLO
Address1:	Not reported
Address2:	Not reported

CENTRAL TECH VOCATIONAL SCHOOL (Continued) **U003313663**

City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 425-4248
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45851
Affiliation Type:	Facility Owner
Company Name:	SYRACUSE CITY SCHOOL DISTRICT
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	725 HARRISON ST.
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13210
Country Code:	001
Phone:	(315) 425-4292
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45851
Affiliation Type:	Mail Contact
Company Name:	SYRACUSE CITY SCHOOL DISTRICT
Contact Type:	Not reported
Contact Name:	ROBERT REIFEISS
Address1:	725 HARRISON ST.
Address2:	Not reported
City:	SYRACUSE
State:	NY
Zip Code:	13210
Country Code:	001
Phone:	(315) 425-4292
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	45851
Affiliation Type:	Facility Operator
Company Name:	CENTRAL TECH
Contact Type:	Not reported
Contact Name:	SYRACUSE CITY SCHOOL DISTRICT
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(315) 425-4300
EMail:	Not reported

CENTRAL TECH VOCATIONAL SCHOOL (Continued) **U003313663**

Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 001
Tank ID: 132351
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 10000
Install Date: Not reported
Date Tank Closed: 06/01/1993
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 00
Date Test: 12/01/1989
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: KCKEMP
Last Modified: 12/11/2024

Equipment Records:

I04 - Overfill - Product Level Gauge (A/G)
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

Q80 **SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDIN** **PA MANIFEST** **S112070198**
NW **258 E ADAMS ST** **N/A**
1/8-1/4 **SYRACUSE, NY 13202**
0.236 mi.
1248 ft. **Site 3 of 3 in cluster Q**

Relative: **Lower**

Actual: **395 ft.**

PA MANIFEST:
Name: SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDING
Address: 258 E ADAMS ST
City,State,Zip: SYRACUSE, NY 13202
Year: 2011
Manifest Number: 003548385FLE
Manifest Type: T
Generator EPA ID: NYD986981520
Generator Date: 08/09/2011
Mailing Address: Not reported
Contact Name: Not reported
Contact Phone: 315-435-4499
TSD EPA ID: PAD067098822
TSD Date: Not reported
TSD Facility Name: CYCLE CHEM INC

SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDING (Continued) **S112070198**

TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D001
Container Number:	1
Container Type:	CF
Waste Quantity:	428
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported
Year:	2011
Manifest Number:	003548385FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	2
Waste Number:	D002
Container Number:	1
Container Type:	DM
Waste Quantity:	152
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported
Year:	2011
Manifest Number:	003548385FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1

SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDING (Continued) **S112070198**

Line Number:	3
Waste Number:	D010
Container Number:	1
Container Type:	DF
Waste Quantity:	4
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported
Year:	2011
Manifest Number:	003548385FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	4
Waste Number:	D002
Container Number:	1
Container Type:	DF
Waste Quantity:	180
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported
Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D002
Container Number:	1
Container Type:	DF
Waste Quantity:	3

SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDING (Continued) **S112070198**

Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported
Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	U122
Container Number:	1
Container Type:	DF
Waste Quantity:	3
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported
Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	1
Waste Number:	D001
Container Number:	1
Container Type:	DF
Waste Quantity:	3
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDING (Continued) **S112070198**

Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	2
Waste Number:	D007
Container Number:	1
Container Type:	DF
Waste Quantity:	3
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	2
Waste Number:	D001
Container Number:	1
Container Type:	DF
Waste Quantity:	3
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011

SYRACUSE CITY SCHOOL DISTRICT CENTRAL TECH BUILDING (Continued) **S112070198**

Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	3
Waste Number:	D002
Container Number:	1
Container Type:	DF
Waste Quantity:	23
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

Year:	2011
Manifest Number:	003548386FLE
Manifest Type:	T
Generator EPA ID:	NYD986981520
Generator Date:	08/09/2011
Mailing Address:	Not reported
Contact Name:	Not reported
Contact Phone:	315-435-4499
TSD EPA ID:	PAD067098822
TSD Date:	Not reported
TSD Facility Name:	CYCLE CHEM INC
TSD Facility Address:	550 INDUSTRIAL DRIVE
TSD Facility City:	LEWISBERRY
TSD Facility State:	PA
Facility Telephone:	Not reported
Page Number:	1
Line Number:	3
Waste Number:	D007
Container Number:	1
Container Type:	DF
Waste Quantity:	23
Unit:	P
Handling Code:	Not reported
TSP EPA ID:	Not reported
Date TSP Sig:	Not reported

Click this hyperlink while viewing on your computer to access
2 additional PA MANIFEST: record(s) in the EDR Site Report.

81
SSE
1/8-1/4
0.243 mi.
1283 ft.

TRIPP KATIE
1429 S MCBRIDE ST
SYRACUSE, NY 13210

RCRA NonGen / NLR **1001224468**
FINDS **NYR000056853**
ECHO
NY MANIFEST

Relative:
Lower

Actual:
399 ft.

RCRA Listings:

Date Form Received by Agency:		20070101
Handler Name:		Tripp Katie
Handler Address:		S Mcbride St
Handler City,State,Zip:		SYRACUSE, NY 13210
EPA ID:		NYR000056853
Contact Name:		JOHN BYRNES
Contact Address:		S MCBRIDE ST
Contact City,State,Zip:		SYRACUSE, NY 13210
Contact Telephone:		315-476-0996
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		02
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Ny
State District:		NYSDEC R7
Mailing Address:		S MCBRIDE ST
Mailing City,State,Zip:		SYRACUSE, NY 13210
Owner Name:	Katie Tripp	
Owner Type:		Private
Operator Name:	Katie Tripp	
Operator Type:		Private
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
202 GPRA Corrective Action Baseline:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No

TRIPP KATIE (Continued) **1001224468**

Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	D008
Waste Description:	Lead

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: KATIE TRIPP	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	1429 S MCBRIDE ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13210
Owner/Operator Telephone:	315-476-0996
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name: KATIE TRIPP	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	1429 S MCBRIDE ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13210
Owner/Operator Telephone:	315-476-0996
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: KATIE TRIPP	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	1429 S MCBRIDE ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13210

TRIPP KATIE (Continued) **1001224468**

Owner/Operator Telephone: 315-476-0996
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20060101
Handler Name: TRIPP KATIE
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: TRIPP KATIE
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19980617
Handler Name: TRIPP KATIE
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

TRIPP KATIE (Continued) **1001224468**

FINDS:
Registry ID: 110004544388

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1001224468
Registry ID: 110004544388

DFR URL:
Name: TRIPP KATIE
Address: 1429 S MCBRIDE ST
City,State,Zip: SYRACUSE, NY 13210

NY MANIFEST:
EPA ID: NYR000056853
Country: USA
Name: Katei Tripp Northern Env
Address: 1429 S MCBRIDE ST
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13210
Zip 4: Not reported
Location Address 1: 1429 S MCBRIDE ST
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: Katei Tripp Northern Env
Mailing Contact: Thomas Strong
Mailing Address 1: 1429 S MCBRIDE ST
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154349848

Manifest Data:
Document ID: PAE9109623
Manifest Status: Not reported
Trans1 State ID: PAAH0549
Year: 1998
Trans2 State ID: Not reported

TRIPP KATIE (Continued) **1001224468**

Generator Ship Date:	07/08/1998
Trans1 Recv Date:	07/08/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/09/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000056853
Trans1 EPA ID:	PAD010154045
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD010154045
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Lead
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00305
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	01.00

M82 **ONONDAGA CO CONVENTION CENTER** **RCRA NonGen / NLR** **1000458352**
NNW **S STATE ST** **NY MANIFEST** **NYD986937431**
1/8-1/4 **SYRACUSE, NY 13202**
0.245 mi.
1294 ft. **Site 5 of 5 in cluster M**

Relative: **Lower**
Actual: **395 ft.**

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	Onondaga Co Convention Center
Handler Address:	S State St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYD986937431
Contact Name:	Not reported
Contact Address:	MONTGOMERY
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported

ONONDAGA CO CONVENTION CENTER (Continued) **1000458352**

Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Ny
State District:		NYSDEC R7
Mailing Address:		MONTGOMERY
Mailing City,State,Zip:		SYRACUSE, NY 13202
Owner Name:	County Of Onondaga	
Owner Type:		Municipal
Operator Name:	County Of Onondaga	
Operator Type:		Municipal
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
202 GPRA Corrective Action Baseline:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No
Addressed Significant Non-Complier Universe:		No
Significant Non-Complier With a Compliance Schedule Universe:		No
Financial Assurance Required:		Not reported
Handler Date of Last Change:		20150414
Recognized Trader-Importer:		No
Recognized Trader-Exporter:		No
Importer of Spent Lead Acid Batteries:		No
Exporter of Spent Lead Acid Batteries:		No
Recycler Activity Without Storage:		No
Manifest Broker:		No
Sub-Part P Indicator:		No

Hazardous Waste Summary:
Waste Code: D001

ONONDAGA CO CONVENTION CENTER (Continued) **1000458352**

Waste Description: Ignitable Waste

Handler - Owner Operator:
Owner/Operator Indicator: Operator
Owner/Operator Name: COUNTY OF ONONDAGA
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COUNTY OF ONONDAGA
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COUNTY OF ONONDAGA
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 19990708
Handler Name: ONONDAGA CO CONVENTION CENTER
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: ONONDAGA CO CONVENTION CENTER
Federal Waste Generator Description: Not a generator, verified

ONONDAGA CO CONVENTION CENTER (Continued) **1000458352**

State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: ONONDAGA CO CONVENTION CENTER
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19910123
Handler Name: ONONDAGA CO CONVENTION CENTER
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920302
Handler Name: ONONDAGA CITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 23332
NAICS Description: Commercial And Institutional Building Construction

Facility Has Received Notices of Violations:
Violations: No Violations Found

ONONDAGA CO CONVENTION CENTER (Continued) **1000458352**

Evaluation Action Summary:
Evaluations: No Evaluations Found

NY MANIFEST:

EPA ID:	NYD986937431
Country:	USA
Name:	Onondaga County Convention Center
Address:	800 SOUTH STATE STREET
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202-0000
Zip 4:	Not reported
Location Address 1:	SOUTH STATE STREET
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Onondaga County Convention Center
Mailing Contact:	T L Heinmiller
Mailing Address 1:	SOUTH STATE STREET
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154352630

Manifest Data:

Document ID:	NYB1734435
Manifest Status:	Not reported
Trans1 State ID:	NYPB2740
Year:	1991
Trans2 State ID:	Not reported
Generator Ship Date:	02/19/1991
Trans1 Recv Date:	02/19/1991
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/22/1991
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986937431
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD043815703
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported

ONONDAGA CO CONVENTION CENTER (Continued) **1000458352**

Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00715
Units:	Gallons (liquids only)
Number of Containers:	013
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00

Document ID:	NYB1734840
Manifest Status:	Not reported
Trans1 State ID:	NYPB2740
Year:	1991
Trans2 State ID:	Not reported
Generator Ship Date:	04/03/1991
Trans1 Recv Date:	04/03/1991
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/04/1991
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986937431
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD043815703
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Lead
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00165
Units:	Gallons (liquids only)
Number of Containers:	003
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	01.00

ONONDAGA CO CONVENTION CENTER (Continued) **1000458352**

Document ID:	NYB1734165
Manifest Status:	Not reported
Trans1 State ID:	LH4202
Year:	1991
Trans2 State ID:	Not reported
Generator Ship Date:	03/19/1991
Trans1 Recv Date:	03/19/1991
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	03/20/1991
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986937431
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD043815703
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	01000
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Treat
Specific Gravity:	01.00

Document ID:	NYB4479399
Manifest Status:	Not reported
Trans1 State ID:	HC6160NY
Year:	1992
Trans2 State ID:	Not reported
Generator Ship Date:	02/27/1992
Trans1 Recv Date:	03/02/1992
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	03/02/1992
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986937431
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD013277454
TSDF ID 2:	Not reported

ONONDAGA CO CONVENTION CENTER (Continued) **1000458352**

Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Lead
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00275
Units:	Gallons (liquids only)
Number of Containers:	005
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

P83 **SYRACUSE COMMUNITY HEALTH CENTER** **RCRA-SQG** **1016144340**
WSW **930 S SALINA ST** **FINDS** **NYR000199190**
1/8-1/4 **SYRACUSE, NY 13202** **ECHO**
0.249 mi. **NY MANIFEST**
1316 ft. **Site 3 of 3 in cluster P**

Relative: **Lower**
Actual: **394 ft.**

RCRA Listings:

Date Form Received by Agency:	20130228
Handler Name:	Syracuse Community Health Center
Handler Address:	S Salina St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYR000199190
Contact Name:	HARVEY L BOX
Contact Address:	PO BOX 515
Contact City,State,Zip:	SYRACUSE, NY 13205
Contact Telephone:	315-476-7917 x345
Contact Fax:	315-476-7990
Contact Email:	LBOX@HUEBER-BREVER.COM
Contact Title:	PROJECT MANAGER HUEBER BREVER CONST
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	S SALINA ST
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	Schc Companies Inc
Owner Type:	Private

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

Operator Name:	Dr Ruben Cowart
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150730
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: SCHC COMPANIES INC	
Legal Status:	Private
Date Became Current:	20050614
Date Ended Current:	Not reported
Owner/Operator Address:	819 S SALINA ST
Owner/Operator City,State,Zip:	SYRACUSE, NY 13202
Owner/Operator Telephone:	315-476-7921
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

Owner/Operator Indicator: Operator
Owner/Operator Name: DR RUBEN COWART
Legal Status: Private
Date Became Current: 20050614
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20130228
Handler Name: SYRACUSE COMMUNITY HEALTH CENTER
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 621111
NAICS Description: Offices Of Physicians (Except Mental Health Specialists)

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110055471458

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1016144340
Registry ID: 110055471458

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

DFR URL:
Name: SYRACUSE COMMUNITY HEALTH CENTER
Address: 930 S SALINA ST
City,State,Zip: SYRACUSE, NY 13202

NY MANIFEST:
EPA ID: NYR000199190
Country: USA
Name: Syracuse Community Health Center
Address: 930 S SALINA ST
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported
Location Address 1: 930 S SALINA ST
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: Syracuse Community Health Center
Mailing Contact: Syracuse Community Health Center
Mailing Address 1: 930 S SALINA ST
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3153742549

Manifest Data:
Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NYR000115733
Year: 2018
Trans2 State ID: Not reported
Generator Ship Date: 03/29/2013
Trans1 Recv Date: 03/29/2013
Trans2 Recv Date: Not reported
TSD Site Recv Date: 04/05/2013
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000199190
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: PAD067098822
TSDF ID 2: Not reported
Manifest Tracking Number: 005727802FLE
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Ignitable Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	20
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	03/29/2013
Trans1 Recv Date:	03/29/2013
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/05/2013
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000199190
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	005727802FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Corrosive Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	03/29/2013
Trans1 Recv Date:	03/29/2013
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/05/2013
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000199190
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	005727802FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Corrosive Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	3
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

Handling Method: Landfill
Specific Gravity: 1

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NYR000115733
Year: 2018
Trans2 State ID: Not reported
Generator Ship Date: 03/29/2013
Trans1 Recv Date: 03/29/2013
Trans2 Recv Date: Not reported
TSD Site Recv Date: 04/05/2013
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000199190
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: PAD067098822
TSDF ID 2: Not reported
Manifest Tracking Number: 005727803FLE
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H141
Waste Code a: Ignitable Waste
Waste Code b: Benzene, Methyl- (Or) Toluene
Waste Code c: Not reported
Waste Code e: Not reported
Waste Code f: Not reported
Waste Code g: Not reported
Waste Code 1: Not reported
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 36
Units: Pounds
Number of Containers: 1
Container Type: Fiberboard or plastic drums, barrels, kegs
Handling Method: Landfill
Specific Gravity: 1

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NYR000115733
Year: 2018
Trans2 State ID: Not reported
Generator Ship Date: 03/29/2013
Trans1 Recv Date: 03/29/2013

SYRACUSE COMMUNITY HEALTH CENTER (Continued) **1016144340**

Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/11/2013
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000199190
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	005727804FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H132
Waste Code a:	B007
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1030
Units:	Kilograms
Number of Containers:	3
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

O84 **1045-1047 SOUTH SALINA STREET** **US BROWNFIELDS** **1016352211**
SW **1045 SOUTH SALINA STREET** **FINDS** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.251 mi.
1324 ft. **Site 2 of 3 in cluster O**

Relative: US BROWNFIELDS:
Lower

Name:	1045-1047 South Salina Street
Address:	1045 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	14742
Property Alias:	Not reported
Recipient Name:	Syracuse, City of
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	Not reported
Latitude:	43.037258

Actual:
391 ft.

1045-1047 SOUTH SALINA STREET (Continued) **1016352211**

Longitude:	-76.149513
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BP
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98229401
Start Date:	2002-09-30 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	2002-09-30 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Not reported
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	U
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported

1045-1047 SOUTH SALINA STREET (Continued) **1016352211**

Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2633
Below Poverty Percent:	54.14
Meidan Income:	1562
Meidan Income Number:	3682
Meidan Income Percent:	75.71
Vacant Housing Number:	281
Vacant Housing Percent:	14.52
Unemployed Number:	369
Unemployed Percent:	7.59

1045-1047 SOUTH SALINA STREET (Continued) **1016352211**

FINDS:
Registry ID: 110039546934

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

O85 **1049-1071 SOUTH SALINA STREET** **US BROWNFIELDS** **1016352214**
SW **1049-1071 SOUTH SALINA STREET** **FINDS** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.261 mi.
1378 ft. **Site 3 of 3 in cluster O**

Relative:
Lower

Actual:
390 ft.

US BROWNFIELDS:

Name:	1049-1071 South Salina Street
Address:	1049-1071 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	14743
Property Alias:	Not reported
Recipient Name:	Syracuse, City of
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	Not reported
Latitude:	43.037208
Longitude:	-76.149506
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BP
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98229401
Start Date:	2002-09-30 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported

1049-1071 SOUTH SALINA STREET (Continued) **1016352214**

Completion Date:	2002-09-30 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Not reported
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	U
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported

1049-1071 SOUTH SALINA STREET (Continued) **1016352214**

RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2563
Below Poverty Percent:	55.02
Meidan Income:	1562
Meidan Income Number:	3603
Meidan Income Percent:	77.35
Vacant Housing Number:	276
Vacant Housing Percent:	14.66
Unemployed Number:	366
Unemployed Percent:	7.86

FINDS:
Registry ID: 110039546961

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

R86 **1073-1079 SOUTH SALINA STREET** **US BROWNFIELDS** **1016352218**
SW **1073-1079 SOUTH SALINA STREET** **FINDS** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.272 mi.
1436 ft. **Site 1 of 4 in cluster R**

Relative: **Lower**
Actual: **390 ft.**

US BROWNFIELDS:

Name:	1073-1079 South Salina Street
Address:	1073-1079 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	14744
Property Alias:	Not reported
Recipient Name:	Syracuse, City of
Grant Type:	Not reported
Property Number:	Not reported

1073-1079 SOUTH SALINA STREET (Continued) **1016352218**

Parcel Size:	Not reported
Latitude:	43.036912
Longitude:	-76.149464
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BP
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98229401
Start Date:	2002-12-31 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	2002-12-31 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Not reported
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	U
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported

1073-1079 SOUTH SALINA STREET (Continued) **1016352218**

Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2598
Below Poverty Percent:	54.51
Meidan Income:	1562
Meidan Income Number:	3674
Meidan Income Percent:	77.09
Vacant Housing Number:	285
Vacant Housing Percent:	14.75
Unemployed Number:	374
Unemployed Percent:	7.85

1073-1079 SOUTH SALINA STREET (Continued) **1016352218**

FINDS:
Registry ID: 110039547005

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

R87 **1081-1085 SOUTH SALINA STREET** **US BROWNFIELDS** **1016352220**
SW **1081-1085 SOUTH SALINA STREET** **FINDS** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.276 mi.
1457 ft. **Site 2 of 4 in cluster R**

Relative: **Lower**
Actual: **390 ft.**

US BROWNFIELDS:

Name:	1081-1085 South Salina Street
Address:	1081-1085 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	14745
Property Alias:	Not reported
Recipient Name:	Syracuse, City of
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	Not reported
Latitude:	43.036813
Longitude:	-76.14945
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BP
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98229401
Start Date:	2002-09-30 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported

1081-1085 SOUTH SALINA STREET (Continued) **1016352220**

Completion Date:	2002-09-30 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Not reported
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	U
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported

1081-1085 SOUTH SALINA STREET (Continued) **1016352220**

RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2632
Below Poverty Percent:	53.85
Meidan Income:	1562
Meidan Income Number:	3718
Meidan Income Percent:	76.06
Vacant Housing Number:	288
Vacant Housing Percent:	14.62
Unemployed Number:	378
Unemployed Percent:	7.73

FINDS:
Registry ID: 110039547032

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

R88 **SOUTH SALINA STREET PARCELS** **NY BROWNFIELDS** **S122449240**
SW **1081 SOUTH SALINA STREET** **NY Spills** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.276 mi.
1457 ft. **Site 3 of 4 in cluster R**

Relative:
Lower

Actual:
390 ft.

BROWNFIELDS:

Name:	SOUTH SALINA STREET PARCELS
Address:	1081 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	570636
Acres:	1.892
HW Code:	C734140
SWIS:	3415

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

Town: Syracuse (c)
Record Added Date: 05/22/2018
Record Updated Date: 06/17/2024
Update By: GWPRISCO
Site Description: "Location: The site is 1.89 acres and is bordered on the west by South Salina Street, across the street from the former Coyne Textile Services Brownfield Cleanup Program site (ref. Site No. C734144); on the south by a church; to the north by a small glass and mirror shop; and to the east by a community center along Montgomery Street. Site Features: Currently, the site is undeveloped with no structures on the property. The site is a relatively flat lot with broken pavement along with grassed-vegetated areas and some mature trees across the property. Current Zoning and Land Use: The site property is zoned as BA District, which permits the intensive development of land for mixed residential, retail, service and certain industrial uses. Adjacent parcels are zoned for commercial (CA) to the north, west, and southwest, BA to the north and south, and residential (RB) to the east. Other nearby parcels are a mix of industrial, commercial, business, and residential land uses. Past Use of the Site: Previously, the site was used as an above-ground storage tank facility for manufactured gas generated from coal or oil. The approximately 125-foot diameter tank, called a gasometer, stored gas for distribution for city and private lighting, cooking, and heating. The facility operated in the late 1890s until taken out of service sometime before 1951. Thereafter, various uses of the site included a rug cleaner, bottling operation, laundry/dry cleaner, automobile repair, refrigerator repair shop, tailor, plumbing shop, paint shop, and a glass warehouse. The buildings were demolished in the late 1970s and early 1980s and then the site was used as a parking lot. Site Geology and Hydrogeology: The greater portion of the site is underlain with a mix of sand, silt, and clay soils that contain historic fill to a depth of approximately 20 feet. The historic fill contains clay tile, ash, coal and brick. Native soil is located below the fill and consists of peat and marl. The depth to water is approximately 7 to 10 feet below grade with groundwater flow direction to the north-west "
Env Problem: "A remedial investigation was conducted to assess the nature and extent of contamination at the site. The remedial investigation consisted of the following elements: the evaluation of buried utilities; collection and analysis of eight surface soil samples; the installation of 33 soil borings which included the collection and analysis of 18 subsurface soil samples; the excavation of six test pits with the analysis of one soil sample; and the installation of five groundwater monitoring wells which included two rounds of groundwater monitoring. Soil and groundwater samples were analyzed for a combination of volatile organic compounds (VOCs), semi-volatile organic compounds (SVOCs), pesticides, herbicides, PCBs, metals (including mercury, cyanide, and hexavalent chromium), 1,4-dioxane, and PFOS/PFOA. Soils: Contaminants of concern have been identified at concentrations that exceed the Restricted-Residential (RR) Soil Cleanup Objectives (SCOs). The contamination of the soils is generally associated within the historical fill material (HFM) at the site. HFM was observed at varying depths from the surface to approximately 20 feet below grade. SVOCs are present in surface soil samples across the site at concentrations that exceed Restricted-Residential Use SCOs. SVOCs and metals are also present in the sub-surface soils within the HFM at concentrations above

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

Restricted Residential Use SCOs. The types and concentrations of SVOCs and metals that have been identified are consistent with those typically found in historically industrialized urban areas. Native soils sampled from beneath the HFM do not exceed RR SCOs for any analytes. These results suggest that the contaminants of concern are contained within the observed on-site HFM. Surface Soil: Sampling depth: 0 to 2 inches A total of eight surface samples were obtained across the site. Laboratory results indicate several SVOCs are above Restricted Residential (RR) use SCOs including, benzo(a)anthracene with concentrations ranging from 1.7 to 5.5 parts per million (ppm) compared to the RR Use SCO value of 1 ppm; benzo(a)pyrene with concentrations ranging from 1.6 to 4.8 ppm compared to the RR Use SCO value of 1 ppm; benzo(b)fluoranthene with concentrations ranging from 2.3 to 6.6 ppm compared to the RR Use SCO value of 1 ppm; chrysene with concentrations ranging 1.7 to 5.2 ppm compared to the RR Use SCO value of 3.9 ppm; dibenzo(a,h)anthracene with concentrations ranging from 0.37 to 0.7 ppm compared to the RR Use SCO value of 0.33 ppm, and indeno (1,2,3-cd)pyrene with concentrations ranging from 1.1 to 2.8 ppm compared to the RR Use SCO value of 0.5 ppm. Sub-Surface Soils: A total of 18 subsurface samples were collected from across the site. Laboratory results of the soils samples obtained from areas containing HFM indicate SVOCs are present at concentrations above Protection of Groundwater SCOs and Restricted-Residential Use SCOs and, to a lesser degree, metals are present at concentrations above Residential-Restricted Use SCOs Laboratory results indicate several SVOCs are above Restricted Residential Use SCOs including, benzo(a)anthracene with concentrations ranging from 1.6 to 51 parts per million (ppm) compared to the RR Use SCO value of 1 ppm; benzo(a)pyrene with concentrations ranging from 1.2 to 39 ppm compared to the RR Use SCO value of 1 ppm; benzo(b)fluoranthene with concentrations ranging from 1.6 to 49 ppm compared to the RR Use SCO value of 1 ppm; benzo(k)fluoranthene with concentrations ranging from 8.2 to 18 ppm compared to the RR Use SCO value of 3.9 ppm; chrysene with concentrations ranging 3.9 to 40 ppm compared to the RR Use SCO value of 3.9 ppm; dibenzo(a,h)anthracene with concentrations ranging from 0.38 to 5.3 ppm compared to the RR Use SCO value of 0.33 ppm; indeno(1,2,3-cd) pyrene with concentrations ranging from 0.72 to 24 ppm compared to the RR Use SCO value of 0.5 ppm, and phenanthrene with a concentration of 100 ppm compared to the RR Use SCO value of 100 ppm. Laboratory results indicate several metals above Restricted Residential Use SCOs including, total copper with a concentration of 495 ppm compared to the RR Use SCO value of 270 ppm; lead with a concentration of 415 ppm compared to the RR Use SCO value of 400 ppm; and total mercury with concentrations ranging from 0.88 to 1.2 ppm compared to the RR Use SCO value of 0.81 ppm. Five test pits were advanced at areas identified as anomalies during a previous geophysical study. At each location, the subsurface contained construction and demolition (C&D) debris, including wood, concrete, brick, asphalt, as well as HFM. Similar observations of fill were made in borings advanced within a large anomaly that coincided with the footprint of the former gasometer. No tanks, vaults, or other subsurface structures were identified while excavating the test pits. In addition, no visual evidence of contamination (e.g., stains or odors) was observed. Due to the presence of ash at test pit TP-4, a sample was collected. Laboratory results indicate no analytes were above Restricted-Residential Use SCOs. Groundwater: Groundwater samples were collected twice, once in

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

October 2019 and again in January 2020, from five groundwater monitoring wells across the site. The depth to groundwater is approximately seven to ten feet below grade with a groundwater flow direction to the northwest. The results of the laboratory analysis indicate the principal groundwater contaminants are volatile organic compounds (VOCs). A number of VOCs were observed above the NYSDEC Technical and Operational Guidance Series (TOGS) groundwater protection standards. The groundwater contamination is primarily located in the central portion of the site in monitoring wells MW-1 and MW-2. Benzene is present at monitoring wells MW-1 and MW-2 with a concentration range from 58 to 190 ppb, compared to the TOGS standard of 1 ppb. Toluene is present in MW-2 with a concentration range from 11 to 40 ppb, compared to the TOGS standard of 5 ppb. Ethylbenzene is present in MW-2 with a concentration range from ND to 19 ppb, compared to the TOGS standard of 5 ppb. P/M xylene is present in MW-2 with a concentration range from ND to 20 ppb, compared to the TOGS standard of 5 ppb. O-xylene is present in MW-2 with a concentration range from ND to 12 ppb, compared to the TOGS standard of 5 ppb. Styrene is present in MW-2 with a concentration range from ND to 8.8 ppb, compared to the TOGS standard of 5 ppb. No other VOCs exceeded NYSDEC TOGS values at the site. There are several semi-volatile organic compounds (SVOCs) that are slightly above NYSDEC TOGS groundwater protection values, with no single compound concentration greater than 0.12 parts per billion (ppb). Laboratory results identified the following compounds above the NYSDEC TOGS value of 0.002 ppb: benzo(a) anthracene ranging from 0.02 to 0.12 ppb; benzo(a)pyrene ranging from 0.02 to 0.09 ppb; benzo(b)fluoranthene ranging from 0.01 to 0.11 ppb; benzo (k)fluoranthene ranging from 0.01 to 0.05 ppb; chrysene ranging from 0.01 to 0.07 ppb; and indeno (1,2,3-cd) pyrene ranging from 0.02 to 0.07 ppb. Laboratory analysis of the groundwater for pesticides, herbicides and PCBs are non-detect at concentrations greater than the laboratory detection limits. Laboratory analysis of the groundwater for PFOA and PFOS indicate concentrations that are below NYS DEC/DOH threshold values. Laboratory analysis results for 1,4 dioxane are non-detect. Metals commonly associated with hard water (e.g., iron, magnesium, manganese, sodium) are present at concentrations above the TOGs values in each well. These metals are likely naturally occurring and in this setting are unrelated to the site's past activities. However, in monitoring well MW-1 barium slightly exceeds the TOGS value of 1,000 ppb, with a concentration value of 1,002 ppb. In addition, the general region of central New York has been known for elevated saline (sodium) concentrations in the groundwater. Laboratory analysis of the groundwater from this site supports this with dissolved sodium concentrations range from 35,200 up to 181,000 parts per billion in comparison to the TOGS value of 20,000 parts per billion. Off-site impacts in soil and groundwater are expected to be minimal based on the level and pattern of on-site contamination. SVOCs are present in surface soil and sub-surface soil across the site at concentrations that exceed Restricted-Residential Use SCOs and Protection of Groundwater SCOs. However, the types and concentrations of SVOCs and metals that have been identified in the soil are typically found at historically industrialized urban areas as in this instance. There are moderate levels of VOCs in site groundwater that are primarily located within the central portion of the site. Concentrations of SVOCs in site groundwater are slightly above groundwater protection values, but SVOCs do not readily migrate. Given the moderate

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

	concentrations of the contaminants of concern in the soil and groundwater it is anticipated the contaminants concentrations will decrease over time due to adsorption and natural attenuation. As a result, it is expected that off-site impacts from on-site contamination to neighboring properties is minimal. "
Health Problem:	"People who enter the site may come into contact with site related soil and groundwater contamination if they dig below the surface. Contaminated groundwater at the site is not used for drinking or other purposes and the site is served by a public water supply that obtains water from a different source not affected by this contamination. Volatile organic compounds in soil vapor (air spaces within the soil) may move into buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. The site is vacant so inhalation of site contaminants in indoor air via the soil vapor intrusion pathway is not a current concern. However, the potential exists for inhalation of site contaminants due to soil vapor intrusion for any future onsite development. Environmental sampling indicates that soil vapor intrusion associated with contamination at the site is not a concern for offsite buildings."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2019-01-07 10:39:00
Record Upd:	2020-02-21 11:10:00
Updated By:	CFMANNES
Own Op:	1
Sub Type:	P03
Owner Name:	Gail Montplaisir
Owner Company:	Salina 1st, LLC
Owner Address:	321 West Taylor Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Honora Spillane
Owner Company:	Syracuse Industrial Development Agency
Owner Address:	City Commons Hall, 201 E. Washington St, 7th Fl.
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Christopher F. Mannes, P.E.
Owner Company:	NYS DEC - Region 7 Office
Owner Address:	615 Erie Blvd. West
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13204
Owner Country:	United States of America

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

Own Op:	6
Sub Type:	P03
Owner Name:	Gail montplaisir
Owner Company:	Salina 1st, LLC
Owner Address:	1341 H Street, Suite 301
Owner Addr2:	Not reported
Owner City,St,Zip:	Wasington, DC 20002
Owner Country:	United States of America
HW Code:	C734140
Waste Type:	barium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	benzo(a)anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	indeno(1,2,3-CD)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	xylene (mixed)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	benzo(k)fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	ethylbenzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	styrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	dibenz[a,h]anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	toluene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	benzo(b)fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

Waste Type:	mercury
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	copper
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	benzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734140
Waste Type:	benzo(a)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	2022-00051127
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2023-10-13 15:52:00
Record Updated:	2023-10-13 15:52:00
Updated By:	ACLOFARO
Crossref ID:	734140
Cross Ref Type Code:	02
Cross Ref Type:	HW Site ID
Record Added Date:	2022-10-17 15:11:00
Record Updated:	2022-10-17 15:11:00
Updated By:	CFMANNES
Crossref ID:	734120
Cross Ref Type Code:	02
Cross Ref Type:	HW Site ID
Record Added Date:	2022-10-17 15:18:00
Record Updated:	2022-10-17 15:18:00
Updated By:	CFMANNES

SPILLS:

Name:	CONTRUCTION SITE
Address:	1081 SOUTH SALINA ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2204171 / 2022-08-18
Facility ID:	2204171
Facility Type:	ER
DER Facility ID:	586819
Site ID:	640303
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2022-08-11
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2022-08-11
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False

SOUTH SALINA STREET PARCELS (Continued) **S122449240**

Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2022-08-11
Spill Record Last Update:	2022-08-18
Spiller Name:	BERTI
Spiller Company:	PARAGON ENVIRONMENTAL CONTRUCTION
Spiller Address:	1081 SOUTH SALINA ST
Spiller Company:	999
Contact Name:	BERTI
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	handled by chris mannes
Remarks:	Clean up completed.

All Materials:

Site ID:	640303
Operable Unit ID:	1387352
Operable Unit:	01
Material ID:	2402272
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

R89 **1101-1111 SOUTH SALINA STREET** **US BROWNFIELDS** **1016352224**
SW **1101-1111 SOUTH SALINA STREET** **FINDS** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.277 mi.
1465 ft. **Site 4 of 4 in cluster R**

Relative: **Lower**

Actual: **390 ft.**

US BROWNFIELDS:

Name:	1101-1111 South Salina Street
Address:	1101-1111 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	14746
Property Alias:	Not reported
Recipient Name:	Syracuse, City of
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	Not reported
Latitude:	43.036312
Longitude:	-76.149452
Census Tract:	36067004200
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BP
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported

1101-1111 SOUTH SALINA STREET (Continued) **1016352224**

Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98229401
Start Date:	2002-09-30 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	2002-09-30 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Not reported
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	U
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported

1101-1111 SOUTH SALINA STREET (Continued) **1016352224**

Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2555
Below Poverty Percent:	53.61
Meidan Income:	1562
Meidan Income Number:	3612
Meidan Income Percent:	75.79
Vacant Housing Number:	283
Vacant Housing Percent:	14.86
Unemployed Number:	354
Unemployed Percent:	7.43

FINDS:
Registry ID: 110039547078

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA)

1101-1111 SOUTH SALINA STREET (Continued) **1016352224**

performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

S90 **680 SOUTH SALINA ST GAS STATION** **NY LTANKS** **S106011637**
WNW **680 SOUTH SALINA ST** **NY Spills** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.281 mi.
1483 ft. **Site 1 of 2 in cluster S**

Relative: **Lower**

Actual: **396 ft.**

LTANKS:

Name:	JUPP CORP
Address:	680 SOUTH SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1600634 / 2019-12-10
Facility ID:	1600634
Site ID:	525912
Spill Date:	2016-04-18
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	D4
Cleanup Ceased:	2017-06-20
SWIS:	3415
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2016-04-18
CID:	Not reported
Water Affected:	NONE
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2016-04-18
Spill Record Last Update:	2019-12-10
Spiller Name:	HARMANDEEP SINGH SEKHON
Spiller Company:	ABMH PROPERTIES LLC
Spiller Address:	81-18-242 ST
Spiller County:	001
Spiller Contact:	BALJIP KAUR
Spiller Phone:	(315) 422-1225
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	43841
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	4/19/2016 - Per John Gramz / Primetime Services, 6,000 gallon UST Tank 857A failed tank tightness test when product discovered in interstitial space. This was the sole remaining functional UST at this location. Previously 8,000 gallon UST Tank 859 (master) failed, effectively also removing satellite 4,000 gallon UST Tank 857B from service due to lack of submersible. PBS # is 7-102830. Contacted Facility owner and operator to determine permanent closure plans for these tanks. KCKemp
Remarks:	inner wall failed test, tank is OOS. unfurther.

All Materials:

680 SOUTH SALINA ST GAS STATION (Continued) **S106011637**

Site ID:	525912
Operable Unit ID:	1274858
Operable Unit:	01
Material ID:	2279520
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	JUPP CORP
Address:	680 SOUTH SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1600634 / 2019-12-10
Facility ID:	1600634
Site ID:	525912
Spill Date:	2016-04-18
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	D4
Cleanup Ceased:	2017-06-20
SWIS:	3415
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2016-04-18
CID:	Not reported
Water Affected:	NONE
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2016-04-18
Spill Record Last Update:	2019-12-10
Spiller Name:	BALJIT KAUR
Spiller Company:	JUPP CORP
Spiller Address:	680 SOUTH SALINA ST
Spiller County:	999
Spiller Contact:	BALJIP KAUR
Spiller Phone:	(315) 422-1225
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	43841
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	4/19/2016 - Per John Gramz / Primetime Services, 6,000 gallon UST Tank 857A failed tank tightness test when product discovered in interstitial space. This was the sole remaining functional UST at this location. Previously 8,000 gallon UST Tank 859 (master) failed, effectively also removing satellite 4,000 gallon UST Tank 857B from service due to lack of submersible. PBS # is 7-102830. Contacted

680 SOUTH SALINA ST GAS STATION (Continued) **S106011637**

	Facility owner and operator to determine permanent closure plans for these tanks. KCKemp
Remarks:	inner wall failed test, tank is OOS. unfurther.

All Materials:

Site ID:	525912
Operable Unit ID:	1274858
Operable Unit:	01
Material ID:	2279520
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	DESIMONES SERVICE STA.
Address:	680 S. SALINA ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8705408 / 1987-10-28
Facility ID:	8705408
Site ID:	265820
Spill Date:	1987-09-28
Spill Cause:	Tank Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	Not reported
Cleanup Ceased:	1987-10-28
SWIS:	3415
Investigator:	AJMARSCH
Referred To:	Not reported
Reported to Dept:	1987-09-28
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1987-10-05
Spill Record Last Update:	1997-11-19
Spiller Name:	Not reported
Spiller Company:	DESIMONES GAS STATION
Spiller Address:	680 S. SALINA ST.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	216600
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was JM / / : REMOVED CONTAMINATED SOIL. HAULED AWAY BY ENV. OIL.

680 SOUTH SALINA ST GAS STATION (Continued) **S106011637**

Remarks: EXCAVATION REVEALED CONTAMINATED SOIL.

All Materials:

Site ID:	265820
Operable Unit ID:	909231
Operable Unit:	01
Material ID:	468011
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

SPILLS:

Name:	DESIMONES GAS STATION
Address:	680 S SALINA ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0211565 / 2003-07-21
Facility ID:	0211565
Facility Type:	ER
DER Facility ID:	235787
Site ID:	291210
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	3415
Spill Date:	2003-02-21
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2003-02-21
CID:	365
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2003-02-21
Spill Record Last Update:	2003-10-06
Spiller Name:	ERNIE DESIMONE
Spiller Company:	DESIMONES GAS STATION
Spiller Address:	680 S SALINA ST
Spiller Company:	001
Contact Name:	ERNIE DESIMONE
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	possilby former leaking tanks or surface spills - got lab results back today indicating gasoline contamination

680 SOUTH SALINA ST GAS STATION (Continued) **S106011637**

All Materials:

Site ID:	291210
Operable Unit ID:	862674
Operable Unit:	01
Material ID:	2106927
Material Code:	1213A
Material Name:	MTBE (methyl-tert-butyl ether)
Case No.:	01634044
Material FA:	Hazardous Material
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	True

Site ID:	291210
Operable Unit ID:	862674
Operable Unit:	01
Material ID:	573999
Material Code:	2645A
Material Name:	BTEX
Case No.:	Not reported
Material FA:	Oxygenates
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	True

Site ID:	291210
Operable Unit ID:	862674
Operable Unit:	01
Material ID:	511351
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	True

Name:	680 SOUTH SALINA ST GAS STATION
Address:	680 SOUTH SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1703133 / 2017-08-17
Facility ID:	1703133
Facility Type:	ER
DER Facility ID:	43841
Site ID:	554293
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	B3
SWIS:	3415
Spill Date:	2017-06-27

680 SOUTH SALINA ST GAS STATION (Continued) **S106011637**

Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2017-06-27
CID:	Not reported
Water Affected:	NONE
Spill Source:	Non Major Facility > 1,100 gal
Spill Notifier:	Other
Cleanup Ceased:	2017-08-17
Cleanup Meets Std:	False
Last Inspection:	2017-06-27
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2017-06-29
Spill Record Last Update:	2020-06-17
Spiller Name:	BALJIT KAUR
Spiller Company:	680 S. SALINA ST LLC
Spiller Address:	3987 WEST LANGERWOOD LN
Spiller Company:	999
Contact Name:	BALJIT KAUR
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	6/27/2017 - PRODUCT OBSERVED BENEATH TANKS WHILE REMOVING TANKS. KCKEMP 8/17/2017 - Closure Report received and filed. Awaiting soil disposal by LSFS. KCKemp
Remarks:	Not reported

All Materials:

Site ID:	554293
Operable Unit ID:	1302370
Operable Unit:	01
Material ID:	2308755
Material Code:	2712
Material Name:	gasoline/ethanol
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Soil, Groundwater
Oxygenate:	Not reported

S91 **DESIMONES SERVICE STA.** **UST FINDER RELEASE** **1029065966**
WNW **680 S. SALINA ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.281 mi.
1483 ft. **Site 2 of 2 in cluster S**

Relative: UST FINDER RELEASE:
Lower

Actual: Object ID:	249455
396 ft. Facility ID:	NY216600
Lust ID:	NY8705408
Name:	DESIMONES SERVICE STA.
Address:	680 S. SALINA ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1987/09/28 16:00:00+00

DESIMONES SERVICE STA. (Continued) **1029065966**

Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	722
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1509
Y Coord:	43.0411
Latitude:	43.0411
Longitude:	-76.1508999999999

T92 **V.A. MEDICAL CENTER** **NY LTANKS** **S103479683**
ESE **800 IRIVING AVENUE** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.288 mi.
1519 ft. **Site 1 of 2 in cluster T**

Relative: LTANKS:
Higher

Name:	VA HOSPITAL
Address:	800 IRIVING AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0402165 / 2004-09-29
Facility ID:	0402165
Site ID:	242917
Spill Date:	2004-05-27
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	BFMATTHE
Referred To:	Not reported
Reported to Dept:	2004-05-27
CID:	444
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False

Actual:
502 ft.

V.A. MEDICAL CENTER (Continued) **S103479683**

Remediation Phase:	0
Date Entered In Computer:	2004-05-27
Spill Record Last Update:	2004-09-29
Spiller Name:	JOHN SLICK
Spiller Company:	VA HOSPITAL
Spiller Address:	800 IRVING AVE
Spiller County:	001
Spiller Contact:	JOHN SLICK
Spiller Phone:	(315) 425-3761
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	186304
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was BM CLOSURE REPORT SHOWS CLEAN.
Remarks:	3000 GALLON TANK WAS REMOVED HAD HOLES AND CONTAMINATED SOIL: THOUGHT TO BE EMPTIED UNSURE WHAT RELEASED: NOT MUCH IN HOLE:

All Materials:

Site ID:	242917
Operable Unit ID:	885972
Operable Unit:	01
Material ID:	489804
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

Name:	V.A. MEDICAL CENTER
Address:	800 IRIVING AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9807877 / 2002-08-06
Facility ID:	9807877
Site ID:	242920
Spill Date:	1998-09-28
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1998-09-28
CID:	312
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0

V.A. MEDICAL CENTER (Continued) **S103479683**

Date Entered In Computer:	1998-09-28
Spill Record Last Update:	2002-08-06
Spiller Name:	JAMES LITTLEFIELD
Spiller Company:	V.A. MEDICAL CENTER
Spiller Address:	800 IRVING AVE
Spiller County:	001
Spiller Contact:	JAMES LITTLEFIELD
Spiller Phone:	(716) 892-5052
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	186304
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM NO DATA SUBMITTED
Remarks:	WORK SITE PHONE #716-830-3093 DON ALDRICH - POSS LEAKING PIPES FROM TANK

T93 **V.A. MEDICAL CENTER** **UST FINDER RELEASE** **1029063478**
ESE **800 IRIVING AVENUE** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.288 mi.
1519 ft. **Site 2 of 2 in cluster T**

Relative:
Higher

Actual:
502 ft.

UST FINDER RELEASE:

Object ID:	249570
Facility ID:	NY186304
Lust ID:	NY9807877
Name:	V.A. MEDICAL CENTER
Address:	800 IRIVING AVENUE
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1998/09/28 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	2150
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1381

V.A. MEDICAL CENTER (Continued) **1029063478**

Y Coord: 43.03939
Latitude: 43.0393899999999
Longitude: -76.1380999999999

94
NW
1/4-1/2
0.292 mi.
1542 ft.

HARRISON PL & E ADAMS ST **NY LTANKS** **S103824165**
HARRISON PL & E ADAMS ST **N/A**
SYRACUSE, NY

Relative:
Lower

Actual:
394 ft.

LTANKS:

Name:	HARRISON PL & E ADAMS ST
Address:	HARRISON PL & E ADAMS ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9814193 / 1999-04-26
Facility ID:	9814193
Site ID:	97685
Spill Date:	1999-02-25
Spill Cause:	Tank Failure
Spill Source:	Passenger Vehicle
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1999-02-25
CID:	205
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1999-02-25
Spill Record Last Update:	1999-04-26
Spiller Name:	Not reported
Spiller Company:	KATHLEEN MCLAGGEN
Spiller Address:	CANDLEWWOD GARDENS A41
Spiller County:	001
Spiller Contact:	CALLER
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	86992
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	GAS TANK SPRUNG A LEAK. CLEANUP COMPLETED.

All Materials:

Site ID:	97685
Operable Unit ID:	1071620
Operable Unit:	01
Material ID:	310897
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported

HARRISON PL & E ADAMS ST (Continued) **S103824165**

Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

U95 **SUNY UPSTATE** **NY LTANKS** **U003077876**
ENE **750 EAST ADAMS ST** **NY CBS** **N/A**
1/4-1/2 **SYRACUSE, NY 13202** **NY AST**
0.297 mi. **NY CBS AST**
1567 ft. **Site 1 of 2 in cluster U** **NY Spills**
NY MANIFEST
Relative:
Higher

Actual:
443 ft.

LTANKS:

Name:	SUNY UPSTATE
Address:	750 EAST ADAMS ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1406531 / 2015-07-22
Facility ID:	1406531
Site ID:	500005
Spill Date:	2014-09-19
Spill Cause:	Tank Test Failure
Spill Source:	Non Major Facility > 1,100 gal
Spill Class:	D4
Cleanup Ceased:	2015-07-22
SWIS:	3415
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2014-09-19
CID:	Not reported
Water Affected:	NONE
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2014-09-19
Spill Record Last Update:	2015-07-22
Spiller Name:	ROB ANDRUS
Spiller Company:	SUNY UPSTATE
Spiller Address:	750 EAST ADAMS ST
Spiller County:	999
Spiller Contact:	ROB ANDRUS
Spiller Phone:	(315) 464-4019
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	455022
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	4/15/2015 - PBS #7-129410. Vent repaired temporarily. Spill to remain open until tank tightness tested. KCKemp 7/22/2015 - Vent repaired and tank tested tight. Spill closed. KCKemp
Remarks:	VENT PIPE CRUSHED DURING CONSTRUCTION. PRIMARY DOES NOT HOLD PRESSURE. NO LEAK SUSPECTED DUE TO RECENT CONSTRUCTION IN AREA THAT MAY HAVE CRUSHED VENT PIPE.

SUNY UPSTATE (Continued) **U003077876**

All Materials:

Site ID:	500005
Operable Unit ID:	1249408
Operable Unit:	01
Material ID:	2250990
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

CBS:

Name:	SUNY HEALTH SCIENCE CENTER
Address:	750 EAST ADAMS STREET
City,State,Zip:	SYRACUSE, NY 13210
CBS Number:	7-000251
Program Type:	CBS
Facility Status:	Unregulated/Closed
Expiration Date:	Not reported
Dec Region:	7
UTMX:	407100.14033
UTMY:	4766179.96721

AST:

Name:	SUNY HEALTH SCIENCE CENTER
Address:	750 EAST ADAMS STREET
City,State,Zip:	SYRACUSE, NY 13210
Region:	STATE
DEC Region:	7
Site Status:	Unregulated/Closed
Facility Id:	7-000251
Program Type:	CBS
UTM X:	407100.14033
UTM Y:	4766179.96721
Expiration Date:	N/A
Site Type:	School

Tank Info:

Tank Number:	H100
Tank Id:	190756
Tank Location:	Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.
Tank Type:	Plastic
Tank Status:	Closed - In Place
Pipe Model:	Not reported
Install Date:	10/01/1993
Capacity Gallons:	1500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported

SUNY UPSTATE (Continued) **U003077876**

Date Tank Closed:	Not reported
Register:	True
Modified By:	MJGRIFFI
Last Modified:	05/09/2022
Material Name:	Not reported

CBS AST:

CBS Number:	7-000251
ICS Number:	Not reported
PBS Number:	7-129410
MOSF Number:	Not reported
SPDES Number:	Not reported
Facility Status:	IN SERVICE
Facility Type:	G
Telephone:	(315) 464-4230
Facility Town:	SYRACUSE (C)
Region:	STATE
Expiration Date:	10/07/1999
Total Capacity of All Active Tanks(gal):	0
Operator:	PHYSICAL PLANT
Emergency Contact:	PHYSICAL PLANT
Emergency Phone:	(315) 464-4230
Owner Name:	SUNY HEALTH SCIENCE CENTER
Owner Address:	750 EAST ADAMS STREET
Owner City,St,Zip:	SYRACUSE, NY 13210
Owner Telephone:	(315) 464-4230
Owner Type:	State Government
Owner Sub Type:	State University of New York
Mail Name:	SUNY HEALTH SCIENCE CENTER
Mail Contact Addr:	750 EAST ADAMS STREET
Mail Contact Addr2:	Not reported
Mail Contact Contact:	GARY W. KITTELL
Mail Contact City,St,Zip:	SYRACUSE, NY 13210
Mail Phone:	(315) 464-4448

Tank Id:	H100
CAS Number:	1310732
Federal ID:	Not reported
Tank Status:	0
Install Date:	10/93
Tank Closed:	00/00
Capacity (Gal):	1500
Chemical:	Sodium hydroxide
Tank Location:	Indoors, Aboveground
Tank Type:	Fiberglass reinforced plastic [FRP]
Total Tanks:	0
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	10/04/1993
Certified Date:	08/07/1997
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None
Pipe Location:	Aboveground
Pipe Type:	Wrapped Steel
Pipe Internal:	None

SUNY UPSTATE (Continued) **U003077876**

Pipe External:	None
Pipe Flag:	None
Leak Detection:	None
Overfill Protection:	Product Level Gauge
Haz Percent:	50
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	/ /
Is It There:	False
Delinquent:	False
Date Expired:	10/07/95
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True
Pre-Printed Renewal App Last Printed:	07/06/1999

SPILLS:

Name:	SUNY MED UNIVERSITY
Address:	750 EAST ADAMS
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0209530 / 2003-06-01
Facility ID:	0209530
Facility Type:	ER
DER Facility ID:	125125
Site ID:	146952
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	3415
Spill Date:	2002-12-16
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2002-12-16
CID:	252
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	2002-12-17
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2002-12-16
Spill Record Last Update:	2003-11-20
Spiller Name:	ROBERT ANDRUS
Spiller Company:	SUNY MED UNIVERSITY
Spiller Address:	750 EAST ADAMS
Spiller Company:	001
Contact Name:	ROBERT ANDRUS
Latitude:	43.0426655
Longitude:	-76.1406306
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM

SUNY UPSTATE (Continued) **U003077876**

Remarks: SPILL IS UNDER INVESTIGATION AT THIS TIME. ARRANGEMENTS FOR CLEANUP TO BE MADE.

All Materials:

Site ID:	146952
Operable Unit ID:	860817
Operable Unit:	01
Material ID:	512951
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	SUNY
Address:	750 EAST ADAMS
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9201660 / 1992-06-01
Facility ID:	9201660
Facility Type:	ER
DER Facility ID:	125125
Site ID:	323015
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	1992-05-11
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	1992-05-11
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	1992-05-11
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1992-06-01
Spill Record Last Update:	1993-03-27
Spiller Name:	Not reported
Spiller Company:	SUNY HEALTH SCIENCE
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was HW 06/01/92: SMALL QUANTITY OF TRANSFORMER OIL SPILLED ONTO CONCRETE PAD. MATERIAL CLEANED UP BY SUNY.

SUNY UPSTATE (Continued) **U003077876**

Remarks: TRANSFORMER LEAKING AT PIPING ONTO CONCRETE PAD. OIL CONTAINS LESS THAN 50 PPM PCB.

All Materials:

Site ID:	323015
Operable Unit ID:	965748
Operable Unit:	01
Material ID:	412952
Material Code:	0016A
Material Name:	non PCB oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3.00
Units:	G
Recovered:	3.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	UPSTATE MEDICAL UNIVERSITY
Address:	750 EAST ADAMS
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1107526 / 2011-09-15
Facility ID:	1107526
Facility Type:	ER
DER Facility ID:	125125
Site ID:	455228
DEC Region:	7
Spill Cause:	Other
Spill Class:	D4
SWIS:	3415
Spill Date:	2011-09-14
Investigator:	DJLASALL
Referred To:	Not reported
Reported to Dept:	2011-09-14
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2011-09-14
Spill Record Last Update:	2011-09-15
Spiller Name:	ROBERT NOBLE
Spiller Company:	LECHASE CONSTRUCTION
Spiller Address:	750 EAST ADAMS
Spiller Company:	999
Contact Name:	ROBERT NOBLE
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	spoke with Mr. Noble. source of spill was old oil lantern buried in ground. Soil and lantern removed to 5 gallon pail. Clean Harbors to handle disposal. NFA
Remarks:	FOUND SOME TYPE OF GREEN OOZE SEEPING OUT WHILE DIGGING TO PUT IN A

SUNY UPSTATE (Continued) **U003077876**

NEW WATER LINE. UNKNOWN WHAT THE MTERIAL IS OR HOW MUCH IS THERE.

All Materials:

Site ID:	455228
Operable Unit ID:	1205382
Operable Unit:	01
Material ID:	2202228
Material Code:	0012A
Material Name:	kerosene
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	SUNY UPSTATE MEDICAL
Address:	750 EAST ADAMS
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1004281 / 2010-08-05
Facility ID:	1004281
Facility Type:	ER
DER Facility ID:	125125
Site ID:	437549
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D3
SWIS:	3415
Spill Date:	2010-07-16
Investigator:	cxrossi
Referred To:	Not reported
Reported to Dept:	2010-07-16
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2010-07-16
Spill Record Last Update:	2010-08-05
Spiller Name:	CLAUDE THAUVETTE
Spiller Company:	SUNY UPSTATE MEDICAL
Spiller Address:	750 EAST ADAMS
Spiller Company:	999
Contact Name:	CLAUDE THAUVETTE
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Small drip from return line of generator. Fitting is not working properly and at time of report contractor is changing out equiptment to stop release. Contaminated soil has been removed and staged on poly and covered. More soil will be removed.

SUNY UPSTATE (Continued) **U003077876**

Remarks: clean up underway

All Materials:
Site ID: 437549
Operable Unit ID: 1188222
Operable Unit: 01
Material ID: 2183136
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 4.00
Units: G
Recovered: 4.00
Resource Affected: Soil
Oxygenate: Not reported

NY MANIFEST:
EPA ID: NYD063053656
Country: USA
Name: Suny Health Science Center
Address: 750 EAST ADAMS STREET
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13210-0000
Zip 4: Not reported
Location Address 1: 750 E ADAMS ST
Location Address 2: 302 CAMPUS ACTIVITIES BLDG
Location City,State,Zip: SYRACUSE, NY 13210
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: Suny Health Science Center
Mailing Contact: Environ Health & Safety
Mailing Address 1: 750 E ADAMS ST
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13210
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154644019

Manifest Data:
Document ID: NYB2182635
Manifest Status: Not reported
Trans1 State ID: LLNJ-0001
Year: 1990
Trans2 State ID: Not reported
Generator Ship Date: 03/29/1990
Trans1 Recv Date: 03/29/1990
Trans2 Recv Date: 03/30/1990
TSD Site Recv Date: 04/02/1990
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD063053656

SUNY UPSTATE (Continued) **U003077876**

Trans1 EPA ID:	NJD041767765
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	FLD980711071
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	The Following Spent Nonhalogenated Solvents: Xylene, Acetone, Ethyl Acetate, Ethyl Benzene, Ethyl Ether, Methyl Isobutyl Ketone, N-Butyl Alcohol, Cyclohexanone, And Methanol; All Spent Solvent Mixtures/Blends Containing, Before Use, Only The Above Spent Nonhalogenated Solvents; And All Spent Solvent Mixtures/Blends Containing, Before Use, One Or More Of The Above Nonhalogenated Solvents, And A Total Of Ten Percent Or More (By Volume) Of One Or More Of Those Solvents Listed In F001, F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	01400
Units:	Pounds
Number of Containers:	007
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYC7142433
Manifest Status:	Not reported
Trans1 State ID:	MU2534
Year:	2003
Trans2 State ID:	Not reported
Generator Ship Date:	08/15/2003
Trans1 Recv Date:	08/15/2003
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/15/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	TXR000050930
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported

SUNY UPSTATE (Continued) **U003077876**

Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00010
Units:	Gallons (liquids only)
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00

Document ID:	NYC7142635
Manifest Status:	Not reported
Trans1 State ID:	NY64167JC
Year:	2003
Trans2 State ID:	Not reported
Generator Ship Date:	09/15/2003
Trans1 Recv Date:	09/15/2003
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/16/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	TXR000050930
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00006

SUNY UPSTATE (Continued) **U003077876**

Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	01.00
Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	2-Propyn-1-Ol (Or) Propargyl Alcohol
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00040
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	Acetyl Chloride (C,R,T)
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00040
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

SUNY UPSTATE (Continued) **U003077876**

Waste Code 12:	Ignitable Waste
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	2,4-Dinitrophenol (Or) Phenol, 2,4-Dinitro-
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00040
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported

SUNY UPSTATE (Continued) **U003077876**

Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	Ignitable Waste
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	Ignitable Waste
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	Ignitable Waste
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported

SUNY UPSTATE (Continued) **U003077876**

Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	Ignitable Waste
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	Ignitable Waste
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	Osmium Oxide Oso4, (T-4)- (Or) Osmium Tetroxide
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00012
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

SUNY UPSTATE (Continued) **U003077876**

Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Cyanogen Bromide (Cn)Br
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	Sodium Cyanide (Or) Sodium Cyanide Na(Cn)
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	2-Propenal (Or) Acrolein
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00005

SUNY UPSTATE (Continued) **U003077876**

Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	Corrosive Waste
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Corrosive Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00

SUNY UPSTATE (Continued) **U003077876**

Waste Code 7:	Ignitable Waste
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	Ignitable Waste
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	Reactive Waste
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported

SUNY UPSTATE (Continued) **U003077876**

Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Dimethyl Sulfate (Or) Sulfuric Acid, Dimethyl Ester
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	Benzene, (Chloromethyl)- (Or) Benzyl Chloride
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00040
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	2-Propenamide (Or) Acrylamide
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00200
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	Phenol
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00400
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999

SUNY UPSTATE (Continued) **U003077876**

Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Selenious Acid (Or) Selenium Dioxide
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	2-Propenamide (Or) Acrylamide
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	Silver Cyanide (Or) Silver Cyanide Ag(Cn)
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	Mercury

SUNY UPSTATE (Continued) **U003077876**

Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	ILA7730584
Manifest Status:	Not reported
Trans1 State ID:	3890
Year:	1999
Trans2 State ID:	1513
Generator Ship Date:	04/09/1999
Trans1 Recv Date:	04/09/1999
Trans2 Recv Date:	04/15/1999
TSD Site Recv Date:	04/22/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD063053656
Trans1 EPA ID:	NJD080631369
Trans2 EPA ID:	MOD095038998
TSDF ID 1:	ILD098642424
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00010
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	Corrosive Waste
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00010

SUNY UPSTATE (Continued) **U003077876**

Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	Corrosive Waste
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00050
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	Reactive Waste
Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00005
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Click this hyperlink while viewing on your computer to access
1478 additional NY MANIFEST: record(s) in the EDR Site Report.

V96 **FORMER COYNE TEXTILE** **NY ENG CONTROLS** **S120706175**
WSW **140 CORTLAND AVENUE** **NY INST CONTROL** **N/A**
1/4-1/2 **SYRACUSE, NY 13202** **NY BROWNFIELDS**
0.299 mi.
1577 ft. **Site 1 of 2 in cluster V**

Relative:
Lower

Actual:
390 ft.

ENG CONTROLS:

Name:	FORMER COYNE TEXTILE
Address:	140 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY 13202
Site Code:	507968
HW Code:	C734144
Control Code:	15
Control Type:	ENG
Date Record Added:	11/05/2021
Date Rec Updated:	12/28/2021
Updated By:	MJBELVEG
Site Description:	"Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east,

FORMER COYNE TEXTILE (Continued) **S120706175**

Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

Dump: False

Structure: False

FORMER COYNE TEXTILE (Continued) **S120706175**

Lagoon:	False
Landfill:	True
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2017-05-18 08:36:00
Record Upd:	2021-05-25 15:20:00
Updated By:	MJBELVEG
Own Op:	1
Sub Type:	E
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	po box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	P03
Owner Name:	Dino Peios
Owner Company:	JMA Tech properties, LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	Liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties Holdings LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	B99
Owner Name:	Web Application
Owner Company:	DECInfo Locator

Owner Address:
Owner Addr2: Not reported

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner City,St,Zip:	NY
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA TECH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	XRN LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA EDGE SERVICES, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	PREVAIL NY LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	CELLH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
HW Code:	C734144
Waste Type:	1,1 dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	cis-1,2-dichloroethene
Waste Quantity:	UNKNOWN

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trichloroethene (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	vinyl chloride
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	iron
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trans-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	beryllium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	magnesium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	bis(2-ethylhexyl)phthalate
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	benzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	copper
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	chromium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	isopropylbenzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	barium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported

FORMER COYNE TEXTILE (Continued) **S120706175**

HW Code:	C734144
Waste Type:	manganese
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	sodium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	thallium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	xylene (mixed)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	C734144-06-15
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2020-02-10 08:30:00
Record Updated:	2020-02-10 08:30:00
Updated By:	MJBELVEG
Crossref ID:	2005960
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2020-10-28 13:03:00
Record Updated:	2020-10-28 13:03:00
Updated By:	MJBELVEG
Crossref ID:	C734144-05-17
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2021-09-09 10:05:00
Record Updated:	2021-09-09 10:05:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048750
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048743
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	1412187
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:56:00
Record Updated:	2015-05-20 10:56:00
Updated By:	SMFITZGE
Crossref ID:	1408779
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:58:00
Record Updated:	2015-05-20 10:58:00

FORMER COYNE TEXTILE (Continued) **S120706175**

Updated By:	SMFITZGE
Crossref ID:	C734144A
Cross Ref Type Code:	22
Cross Ref Type:	BCP Site ID
Record Added Date:	2019-01-02 13:56:00
Record Updated:	2019-01-02 13:56:00
Updated By:	MJBELVEG
Name:	FORMER COYNE TEXTILE
Address:	140 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY 13202
Site Code:	507968
HW Code:	C734144
Control Code:	36
Control Type:	ENG
Date Record Added:	11/05/2021
Date Rec Updated:	12/28/2021
Updated By:	MJBELVEG
Site Description:	"Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land

FORMER COYNE TEXTILE (Continued) **S120706175**

	with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."
Env Problem:	"Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "
Health Problem:	"Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	True
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2017-05-18 08:36:00
Record Upd:	2021-05-25 15:20:00
Updated By:	MJBELVEG
Own Op:	1
Sub Type:	E
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	po box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator

Owner Address:
Owner Addr2: Not reported
Owner City,St,Zip: NY
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	PREVAIL NY LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	CELLH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
HW Code:	C734144
Waste Type:	1,1 dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	cis-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trichloroethene (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	vinyl chloride
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	iron
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trans-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	beryllium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	magnesium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Type:	bis(2-ethylhexyl)phthalate
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	benzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	copper
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	chromium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	isopropylbenzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	barium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	manganese
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	sodium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	thallium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	xylene (mixed)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	C734144-06-15
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2020-02-10 08:30:00
Record Updated:	2020-02-10 08:30:00
Updated By:	MJBELVEG
Crossref ID:	2005960
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2020-10-28 13:03:00
Record Updated:	2020-10-28 13:03:00
Updated By:	MJBELVEG
Crossref ID:	C734144-05-17
Cross Ref Type Code:	23

FORMER COYNE TEXTILE (Continued) **S120706175**

Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2021-09-09 10:05:00
Record Updated:	2021-09-09 10:05:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048750
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048743
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	1412187
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:56:00
Record Updated:	2015-05-20 10:56:00
Updated By:	SMFITZGE
Crossref ID:	1408779
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:58:00
Record Updated:	2015-05-20 10:58:00
Updated By:	SMFITZGE
Crossref ID:	C734144A
Cross Ref Type Code:	22
Cross Ref Type:	BCP Site ID
Record Added Date:	2019-01-02 13:56:00
Record Updated:	2019-01-02 13:56:00
Updated By:	MJBELVEG

Name:	FORMER COYNE TEXTILE
Address:	140 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY 13202
Site Code:	507968
HW Code:	C734144
Control Code:	13
Control Type:	ENG
Date Record Added:	11/05/2021
Date Rec Updated:	12/28/2021
Updated By:	MJBELVEG
Site Description:	"Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South

FORMER COYNE TEXTILE (Continued) **S120706175**

Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

Dump: False
Structure: False
Lagoon: False
Landfill: True
Pond: False

FORMER COYNE TEXTILE (Continued) **S120706175**

Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2017-05-18 08:36:00
Record Upd:	2021-05-25 15:20:00
Updated By:	MJBELVEG
Own Op:	1
Sub Type:	E
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	po box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	P03
Owner Name:	Dino Peios
Owner Company:	JMA Tech properties, LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	Liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties Holdings LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	B99
Owner Name:	Web Application
Owner Company:	DECInfo Locator

Owner Address:

Owner Addr2:	Not reported
Owner City,St,Zip:	NY
Owner Country:	United States of America
Own Op:	6

FORMER COYNE TEXTILE (Continued) **S120706175**

Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA TECH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	XRN LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA EDGE SERVICES, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	PREVAIL NY LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	CELLH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
HW Code:	C734144
Waste Type:	1,1 dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	cis-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trichloroethene (TCE)

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: vinyl chloride
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: iron
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trans-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: beryllium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: magnesium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: benzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: copper
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: chromium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: isopropylbenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: manganese
Waste Quantity: UNKNOWN

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Code:	Not reported
HW Code:	C734144
Waste Type:	sodium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	thallium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	xylene (mixed)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	C734144-06-15
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2020-02-10 08:30:00
Record Updated:	2020-02-10 08:30:00
Updated By:	MJBELVEG
Crossref ID:	2005960
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2020-10-28 13:03:00
Record Updated:	2020-10-28 13:03:00
Updated By:	MJBELVEG
Crossref ID:	C734144-05-17
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2021-09-09 10:05:00
Record Updated:	2021-09-09 10:05:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048750
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048743
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	1412187
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:56:00
Record Updated:	2015-05-20 10:56:00
Updated By:	SMFITZGE
Crossref ID:	1408779
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:58:00
Record Updated:	2015-05-20 10:58:00
Updated By:	SMFITZGE
Crossref ID:	C734144A
Cross Ref Type Code:	22

FORMER COYNE TEXTILE (Continued) **S120706175**

Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG

INST CONTROL:
Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: Monitoring Plan
HW Code: C734144
Control Code: 31
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land

FORMER COYNE TEXTILE (Continued) **S120706175**

with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

Dump: False
Structure: False
Lagoon: False
Landfill: True
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-05-18 08:36:00
Record Upd: 2021-05-25 15:20:00
Updated By: MJBELVEG
Own Op: 1
Sub Type: E
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: po box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Not reported
Owner Company: Onondaga County Public Library

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator

Owner Address:
Owner Addr2: Not reported
Owner City,St,Zip: NY
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: cis-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trichloroethene (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: vinyl chloride
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: iron
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trans-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: beryllium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: magnesium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: benzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: copper
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: chromium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: isopropylbenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: manganese
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: sodium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG
Crossref ID: C734144-05-17
Cross Ref Type Code: 23

FORMER COYNE TEXTILE (Continued) **S120706175**

Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00
Record Updated: 2015-05-20 10:58:00
Updated By: SMFITZGE
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG

Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: Site Management Plan
HW Code: C734144
Control Code: 32
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial

FORMER COYNE TEXTILE (Continued) **S120706175**

buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

Dump: False

Structure: False

Lagoon: False

FORMER COYNE TEXTILE (Continued) **S120706175**

Landfill: True
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-05-18 08:36:00
Record Upd: 2021-05-25 15:20:00
Updated By: MJBELVEG
Own Op: 1
Sub Type: E
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: po box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator

Owner Address:
Owner Addr2: Not reported
Owner City,St,Zip: NY

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: cis-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported

FORMER COYNE TEXTILE (Continued) **S120706175**

HW Code: C734144
Waste Type: trichloroethene (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: vinyl chloride
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: iron
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trans-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: beryllium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: magnesium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: benzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: copper
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: chromium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: isopropylbenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Type: manganese
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: sodium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG
Crossref ID: C734144-05-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00
Record Updated: 2015-05-20 10:58:00
Updated By: SMFITZGE

FORMER COYNE TEXTILE (Continued) **S120706175**

Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG

Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: IC/EC Plan
HW Code: C734144
Control Code: 34
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward

FORMER COYNE TEXTILE (Continued) **S120706175**

to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

Dump: False
Structure: False
Lagoon: False
Landfill: True
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-05-18 08:36:00
Record Upd: 2021-05-25 15:20:00
Updated By: MJBELVEG
Own Op: 1
Sub Type: E
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: po box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Not reported

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator

Owner Address:
Owner Addr2: Not reported
Owner City,St,Zip: NY
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Company: JMA EDGE SERVICES, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: cis-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trichloroethene (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: vinyl chloride
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: iron
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trans-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: beryllium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: magnesium
Waste Quantity: UNKNOWN
Waste Code: Not reported

FORMER COYNE TEXTILE (Continued) **S120706175**

HW Code: C734144
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: benzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: copper
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: chromium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: isopropylbenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: manganese
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: sodium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG
Crossref ID: C734144-05-17

FORMER COYNE TEXTILE (Continued) **S120706175**

Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00
Record Updated: 2015-05-20 10:58:00
Updated By: SMFITZGE
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG

Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: Ground Water Use Restriction
HW Code: C734144
Control Code: 08
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east,

FORMER COYNE TEXTILE (Continued) **S120706175**

Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

Dump: False

Structure: False

FORMER COYNE TEXTILE (Continued) **S120706175**

Lagoon: False
Landfill: True
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-05-18 08:36:00
Record Upd: 2021-05-25 15:20:00
Updated By: MJBELVEG
Own Op: 1
Sub Type: E
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: po box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator

Owner Address:
Owner Addr2: Not reported

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner City,St,Zip: NY
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: cis-1,2-dichloroethene
Waste Quantity: UNKNOWN

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Code: Not reported
HW Code: C734144
Waste Type: trichloroethene (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: vinyl chloride
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: iron
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trans-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: beryllium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: magnesium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: benzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: copper
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: chromium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: isopropylbenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported

FORMER COYNE TEXTILE (Continued) **S120706175**

HW Code: C734144
Waste Type: manganese
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: sodium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG
Crossref ID: C734144-05-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00
Record Updated: 2015-05-20 10:58:00

FORMER COYNE TEXTILE (Continued) **S120706175**

Updated By: SMFITZGE
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG

Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: Landuse Restriction
HW Code: C734144
Control Code: 25
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west

FORMER COYNE TEXTILE (Continued) **S120706175**

have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

Dump: False
Structure: False
Lagoon: False
Landfill: True
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-05-18 08:36:00
Record Upd: 2021-05-25 15:20:00
Updated By: MJBELVEG
Own Op: 1
Sub Type: E
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: po box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator

Owner Address:
Owner Addr2: Not reported
Owner City,St,Zip: NY
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: cis-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trichloroethene (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: vinyl chloride
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: iron
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trans-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: beryllium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: magnesium
Waste Quantity: UNKNOWN

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Code: Not reported
HW Code: C734144
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: benzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: copper
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: chromium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: isopropylbenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: manganese
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: sodium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG

FORMER COYNE TEXTILE (Continued) **S120706175**

Crossref ID: C734144-05-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00
Record Updated: 2015-05-20 10:58:00
Updated By: SMFITZGE
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG

Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: Environmental Easement
HW Code: C734144
Control Code: J
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by

FORMER COYNE TEXTILE (Continued) **S120706175**

commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

Dump: False

FORMER COYNE TEXTILE (Continued) **S120706175**

Structure: False
Lagoon: False
Landfill: True
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-05-18 08:36:00
Record Upd: 2021-05-25 15:20:00
Updated By: MJBELVEG
Own Op: 1
Sub Type: E
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: po box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Address:
Owner Addr2: Not reported
Owner City,St,Zip: NY
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported

FORMER COYNE TEXTILE (Continued) **S120706175**

HW Code:	C734144
Waste Type:	cis-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trichloroethene (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	vinyl chloride
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	iron
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trans-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	beryllium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	magnesium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	bis(2-ethylhexyl)phthalate
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	benzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	copper
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	chromium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	isopropylbenzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: manganese
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: sodium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG
Crossref ID: C734144-05-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01

FORMER COYNE TEXTILE (Continued) **S120706175**

Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00
Record Updated: 2015-05-20 10:58:00
Updated By: SMFITZGE
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG

Name: FORMER COYNE TEXTILE
Address: 140 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY 13202
Site Code: 507968
Control Name: O&M Plan
HW Code: C734144
Control Code: 33
Control Type: INST
Dt record added: 11/05/2021
Dt rec updated: 12/28/2021
Updated By: MJBELVEG
Site Code: 507968
Site Description: "Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup

FORMER COYNE TEXTILE (Continued) **S120706175**

Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater, and soil vapor is being managed under a Site Management Plan. "

Health Problem: "Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."

Dump: False
Structure: False
Lagoon: False
Landfill: True
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-05-18 08:36:00
Record Upd: 2021-05-25 15:20:00
Updated By: MJBELVEG
Own Op: 1
Sub Type: E
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: po box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: Ranalli/Taylor St., LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Dino Peios
Owner Company: JMA Tech properties, LLC
Owner Address: PO Box 678
Owner Addr2: Not reported
Owner City,St,Zip: Liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties Holdings LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: Document Repository
Sub Type: B99
Owner Name: Web Application
Owner Company: DECInfo Locator

Owner Address:
Owner Addr2: Not reported
Owner City,St,Zip: NY
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA Tech Properties, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA TECH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: XRN LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: JMA EDGE SERVICES, LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: PREVAIL NY LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Dino peios
Owner Company: CELLH LLC
Owner Address: 7645 Henry Clay Blvd.
Owner Addr2: Not reported
Owner City,St,Zip: liverpool, NY 13088
Owner Country: United States of America
HW Code: C734144
Waste Type: 1,1 dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: cis-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trichloroethene (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: vinyl chloride
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: iron
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: trans-1,2-dichloroethene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: beryllium
Waste Quantity: UNKNOWN
Waste Code: Not reported

FORMER COYNE TEXTILE (Continued) **S120706175**

HW Code: C734144
Waste Type: magnesium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: benzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: copper
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: chromium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: isopropylbenzene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: manganese
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: sodium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: thallium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C734144
Waste Type: xylene (mixed)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C734144-06-15
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2020-02-10 08:30:00
Record Updated: 2020-02-10 08:30:00
Updated By: MJBELVEG
Crossref ID: 2005960
Cross Ref Type Code: 01
Cross Ref Type: Spill No.

FORMER COYNE TEXTILE (Continued) **S120706175**

Record Added Date: 2020-10-28 13:03:00
Record Updated: 2020-10-28 13:03:00
Updated By: MJBELVEG
Crossref ID: C734144-05-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2021-09-09 10:05:00
Record Updated: 2021-09-09 10:05:00
Updated By: MJBELVEG
Crossref ID: 2021-00048750
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 2021-00048743
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2021-11-04 07:19:00
Record Updated: 2021-11-04 07:19:00
Updated By: MJBELVEG
Crossref ID: 1412187
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:56:00
Record Updated: 2015-05-20 10:56:00
Updated By: SMFITZGE
Crossref ID: 1408779
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2015-05-20 10:58:00
Record Updated: 2015-05-20 10:58:00
Updated By: SMFITZGE
Crossref ID: C734144A
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2019-01-02 13:56:00
Record Updated: 2019-01-02 13:56:00
Updated By: MJBELVEG

BROWNFIELDS:

Name:	FORMER COYNE TEXTILE
Address:	140 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	507968
Acres:	3.255
HW Code:	C734144
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	05/15/2015
Record Updated Date:	01/08/2025
Update By:	GWPRISCO
Site Description:	"Location: The site is located at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous site areas. South Clinton Street and the 5G manufacturing facility and offices are known as 140 Cortland Avenue and consist of two parcels of land totaling

FORMER COYNE TEXTILE (Continued) **S120706175**

approximately 2.4 acres. The other site area is known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street, and constitute two parcels totaling approximately 0.86 acres. The site limits are generally bounded by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and vacant commercial/industrial buildings to the west. The site is currently active and zoned for commercial use. Site Features: 140 Cortland Ave. and the South Clinton Street area consists of one building used for the manufacturing of 5G products. These parcels also consist of sidewalks, driveways, parking areas, and limited vegetation. The other area consists of a small park and a parking lot. Current Zoning and Land Use: The site is currently active as a 5G manufacturing facility and is zoned for commercial use. The general area surrounding the site is highly developed and consists of commercial and industrial facilities. Several rows of multifamily houses are located northwest of the site. Past Use of the Site: For more than 100 years, the site was used for industrial purposes, including a machine shop and rug manufacturing before Coyne Textile Services began operation in 1938. As an industrial dry-cleaning facility, the site utilized tetrachloroethene (PCE) and Stoddard solvent (a non-chlorinated solvent) until 2000. Several property owners had structures on what is now the employee parking lot, dating back to 1892 when the location was a brick and mortar building that housed a stone cutting facility. Syracuse Transit Corporation had a bus storage and repair building on the parcel beginning in 1951. From 1989 until acquisition by the current owner, the parcel was used for employee parking and a small greenspace. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. LLC purchased the property in 2016 and entered a Brownfield Cleanup Agreement (BCA) in September 2017. Site Geology and Hydrogeology: The site has an approximate elevation of 390 feet above mean sea level and is relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient, which slopes downward to Onondaga Creek. Site soils are tight and consist of Urban Land with the bedrock anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The exact depth of the bedrock is unknown at the site, but it is known to be at a depth greater than 80 feet bgs. The estimated depth to groundwater is less than 15 feet below ground surface. The groundwater in the area appears to be brackish saline. Groundwater at the site is assumed to flow to the northwest toward Onondaga Creek. However, localized flow directions in the area of the site may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the site, which flows in a northerly direction towards Onondaga Lake."

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were tetrachloroethene (PCE) and barium in soil, 1,1-dichloroethene, isopropylbenzene (Cumene), tetrachloroethene, trichloroethene, xylene (Total), cis-1,2-dichloroethene, trans-1,2-dichloroethene, benzene, vinyl chloride, bis(2-Ethylhexyl)phthalate, barium, and magnesium in groundwater and tetrachloroethene and trichloroethene in soil vapor. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil, groundwater,

FORMER COYNE TEXTILE (Continued) **S120706175**

	and soil vapor is being managed under a Site Management Plan. "
Health Problem:	"Remedial action are complete and measures are in place to prevent people from coming into contact with remaining contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	True
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2017-05-18 08:36:00
Record Upd:	2021-05-25 15:20:00
Updated By:	MJBELVEG
Own Op:	1
Sub Type:	E
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	po box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	Ranalli/Taylor St., LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	P03
Owner Name:	Dino Peios
Owner Company:	JMA Tech properties, LLC
Owner Address:	PO Box 678
Owner Addr2:	Not reported
Owner City,St,Zip:	Liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties Holdings LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	B99

FORMER COYNE TEXTILE (Continued) **S120706175**

Owner Name:	Web Application
Owner Company:	DECInfo Locator
Owner Address:	
Owner Addr2:	Not reported
Owner City,St,Zip:	NY
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA Tech Properties, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA TECH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	XRN LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	JMA EDGE SERVICES, LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	PREVAIL NY LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino peios
Owner Company:	CELLH LLC
Owner Address:	7645 Henry Clay Blvd.
Owner Addr2:	Not reported
Owner City,St,Zip:	liverpool, NY 13088
Owner Country:	United States of America
HW Code:	C734144
Waste Type:	1,1 dichloroethene

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	cis-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trichloroethene (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	vinyl chloride
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	iron
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	trans-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	beryllium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	magnesium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	bis(2-ethylhexyl)phthalate
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	benzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	copper
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	chromium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	isopropylbenzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	lead
Waste Quantity:	UNKNOWN

FORMER COYNE TEXTILE (Continued) **S120706175**

Waste Code:	Not reported
HW Code:	C734144
Waste Type:	barium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	manganese
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	sodium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	thallium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144
Waste Type:	xylene (mixed)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	C734144-06-15
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2020-02-10 08:30:00
Record Updated:	2020-02-10 08:30:00
Updated By:	MJBELVEG
Crossref ID:	2005960
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2020-10-28 13:03:00
Record Updated:	2020-10-28 13:03:00
Updated By:	MJBELVEG
Crossref ID:	C734144-05-17
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2021-09-09 10:05:00
Record Updated:	2021-09-09 10:05:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048750
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	2021-00048743
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2021-11-04 07:19:00
Record Updated:	2021-11-04 07:19:00
Updated By:	MJBELVEG
Crossref ID:	1412187
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:56:00
Record Updated:	2015-05-20 10:56:00
Updated By:	SMFITZGE

FORMER COYNE TEXTILE (Continued) **S120706175**

Crossref ID:	1408779
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2015-05-20 10:58:00
Record Updated:	2015-05-20 10:58:00
Updated By:	SMFITZGE
Crossref ID:	C734144A
Cross Ref Type Code:	22
Cross Ref Type:	BCP Site ID
Record Added Date:	2019-01-02 13:56:00
Record Updated:	2019-01-02 13:56:00
Updated By:	MJBELVEG

V97 **RENALLI TAYLOR ST LLC** **NY LTANKS** **1000311573**
WSW **140 CORTLAND AVE** **NY CBS** **NYD013250618**
1/4-1/2 **SYRACUSE, NY 13202** **NY CBS AST**
0.299 mi. **NY BROWNFIELDS**
1577 ft. **Site 2 of 2 in cluster V** **NY Spills**
RCRA NonGen / NLR
Relative: **ICIS**
Lower **US AIRS**
Actual: **FINDS**
390 ft. **ECHO**
PFAS ECHO
NY DRYCLEANERS
NY MANIFEST
RI MANIFEST

LTANKS:

Name:	COYNE TEXTILE
Address:	140 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9604373 / 1996-07-02
Facility ID:	9604373
Site ID:	156885
Spill Date:	1996-07-01
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	D5
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1996-07-01
CID:	282
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1996-07-01
Spill Record Last Update:	1996-07-03
Spiller Name:	SAME
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller County:	001

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Spiller Contact:	DJ SMITH
Spiller Phone:	(315) 475-1626
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	132732
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM CLOSE SPILL REFER TO DIV. OF WATER.
Remarks:	waste water sludge is the spill it went on to the road and went into a storm drain.

All Materials:

Site ID:	156885
Operable Unit ID:	1032027
Operable Unit:	01
Material ID:	350664
Material Code:	0064A
Material Name:	unknown material
Case No.:	Not reported
Material FA:	Other
Quantity:	10.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

CBS:

Name:	COYNE TEXTILE SERVICES
Address:	140 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY 13202
CBS Number:	7-000217
Program Type:	CBS
Facility Status:	Active
Expiration Date:	08/19/2017
Dec Region:	7
UTMX:	406264.72814
UTMY:	4765538.10119

CBS AST:

CBS Number:	7-000217
ICS Number:	7-178107
PBS Number:	7-072842
MOSF Number:	Not reported
SPDES Number:	Not reported
Facility Status:	IN SERVICE
Facility Type:	I
Telephone:	(315) 475-1626
Facility Town:	SYRACUSE (C)
Region:	STATE
Expiration Date:	08/19/2001
Total Capacity of All Active Tanks(gal):	883
Operator:	JIM BARNES
Emergency Contact:	D.J. SMITH
Emergency Phone:	(315) 475-1626
Owner Name:	COYNE TEXTILE SERVICES

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Owner Address:	140 CORTLAND AVENUE
Owner City,St,Zip:	SYRACUSE, NY 13202
Owner Telephone:	(315) 475-1626
Owner Type:	Corporate/Commercial
Owner Sub Type:	Not reported
Mail Name:	COYNE TEXTILE SERVICES
Mail Contact Addr:	140 CORTLAND AVENUE
Mail Contact Addr2:	PO BOX 4854
Mail Contact Contact:	D.J. SMITH
Mail Contact City,St,Zip:	SYRACUSE, NY 13202
Mail Phone:	(315) 475-1626

Tank Id:	006
CAS Number:	7705080
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	11/95
Tank Closed:	Not reported
Capacity (Gal):	437
Chemical:	Ferric chloride
Tank Location:	Indoors, Aboveground
Tank Type:	Fiberglass reinforced plastic [FRP]
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	01/11/1999
Certified Date:	07/09/1999
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None
Pipe Location:	Aboveground
Pipe Type:	Double Walled Fiberglass
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Pipe Flag:	Painted/Asphalt Coating
Leak Detection:	None
Overfill Protection:	None
Haz Percent:	50
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	43|02| / 76|09|
Is Updated:	False
Renew Date:	09/27/93
Is It There:	False
Delinquent:	False
Date Expired:	08/19/93
Owner Mark:	1
Certificate Needs to be Printed:	43|02| / 76|09|
Fiscal Amt for Registration Fee Correct:	43|02| / 76|09|
Renewal Has Been Printed for Facility:	43|02| / 76|09|
Pre-Printed Renewal App Last Printed:	43|02| / 76|09|

Tank Id:	002
CAS Number:	1330207

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Federal ID:	Not reported
Tank Status:	In Service
Install Date:	11/91
Tank Closed:	00/00
Capacity (Gal):	5000
Chemical:	Xylene (mixed)
Tank Location:	Indoors, Belowground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	12/22/1993
Certified Date:	07/09/1999
Substance:	More than one Hazardous Substance on DEC List
Internal Protection:	Epoxy Liner
External Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Galvanized Steel
Pipe Internal:	None
Pipe External:	Wrapped (Piping
Pipe Flag:	Wrapped (Piping
Leak Detection:	Concrete Pad w/channels
Overfill Protection:	Catch Basin
Haz Percent:	10
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	43|02| / 76|09|
Is Updated:	False
Renew Date:	09/27/93
Is It There:	False
Delinquent:	False
Date Expired:	08/19/93
Owner Mark:	1
Certificate Needs to be Printed:	43|02| / 76|09|
Fiscal Amt for Registration Fee Correct:	43|02| / 76|09|
Renewal Has Been Printed for Facility:	43|02| / 76|09|
Pre-Printed Renewal App Last Printed:	43|02| / 76|09|

Tank Id:	003
CAS Number:	1330207
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	11/91
Tank Closed:	00/00
Capacity (Gal):	5000
Chemical:	Xylene (mixed)
Tank Location:	Indoors, Belowground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	12/22/1993
Certified Date:	07/09/1999

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Substance:	More than one Hazardous Substance on DEC List
Internal Protection:	Epoxy Liner
External Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Galvanized Steel
Pipe Internal:	None
Pipe External:	Wrapped (Piping
Pipe Flag:	Wrapped (Piping
Leak Detection:	Concrete Pad w/channels
Overfill Protection:	Catch Basin
Haz Percent:	10
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	43|02| / 76|09|
Is Updated:	False
Renew Date:	09/27/93
Is It There:	False
Delinquent:	False
Date Expired:	08/19/93
Owner Mark:	1
Certificate Needs to be Printed:	43|02| / 76|09|
Fiscal Amt for Registration Fee Correct:	43|02| / 76|09|
Renewal Has Been Printed for Facility:	43|02| / 76|09|
Pre-Printed Renewal App Last Printed:	43|02| / 76|09|

Tank Id:	004
CAS Number:	7664939
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	07/93
Tank Closed:	01/99
Capacity (Gal):	220
Chemical:	Sulfuric acid
Tank Location:	Indoors, Aboveground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	None
Tank Error Status:	No Missing Data
Date Entered:	12/22/1993
Certified Date:	07/09/1999
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Double Walled Fiberglass
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Pipe Flag:	Painted/Asphalt Coating
Leak Detection:	None
Overfill Protection:	Catch Basin
Haz Percent:	98
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Lat/Long:	43|02| / 76|09|
Is Updated:	False
Renew Date:	09/27/93
Is It There:	False
Delinquent:	False
Date Expired:	08/19/93
Owner Mark:	1
Certificate Needs to be Printed:	43|02| / 76|09|
Fiscal Amt for Registration Fee Correct:	43|02| / 76|09|
Renewal Has Been Printed for Facility:	43|02| / 76|09|
Pre-Printed Renewal App Last Printed:	43|02| / 76|09|

Tank Id:	001
CAS Number:	127184
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	07/91
Tank Closed:	00/00
Capacity (Gal):	275
Chemical:	Tetrachloroethylene
Tank Location:	Indoors, Aboveground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	00
Tank Error Status:	No Missing Data
Date Entered:	08/13/1991
Certified Date:	07/09/1999
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None,Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	01
Pipe Flag:	01
Leak Detection:	00
Overfill Protection:	04
Haz Percent:	99
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	43|02| / 76|09|
Is Updated:	False
Renew Date:	09/27/93
Is It There:	False
Delinquent:	False
Date Expired:	08/19/93
Owner Mark:	1
Certificate Needs to be Printed:	43|02| / 76|09|
Fiscal Amt for Registration Fee Correct:	43|02| / 76|09|
Renewal Has Been Printed for Facility:	43|02| / 76|09|
Pre-Printed Renewal App Last Printed:	43|02| / 76|09|

Tank Id:	005

RENALLI TAYLOR ST LLC (Continued) **1000311573**

CAS Number:	7664939
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	01/92
Tank Closed:	Not reported
Capacity (Gal):	446
Chemical:	Sulfuric acid
Tank Location:	Indoors, Aboveground
Tank Type:	Steel/carbon steel
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	Vault
Tank Error Status:	No Missing Data
Date Entered:	12/22/1993
Certified Date:	07/09/1999
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Double Walled Fiberglass
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Pipe Flag:	Painted/Asphalt Coating
Leak Detection:	None
Overfill Protection:	None
Haz Percent:	98
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	3115
Lat/Long:	43|02| / 76|09|
Is Updated:	False
Renew Date:	09/27/93
Is It There:	False
Delinquent:	False
Date Expired:	08/19/93
Owner Mark:	1
Certificate Needs to be Printed:	43|02| / 76|09|
Fiscal Amt for Registration Fee Correct:	43|02| / 76|09|
Renewal Has Been Printed for Facility:	43|02| / 76|09|
Pre-Printed Renewal App Last Printed:	43|02| / 76|09|

BROWNFIELDS:

Name:	FORMER COYNE TEXTILE - OFF-SITE
Address:	140 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	580830
Acres:	Not reported
HW Code:	C734144A
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	12/27/2018
Record Updated Date:	02/27/2024
Update By:	GWPRISCO
Site Description:	"Location: The on-site portion is located in an urban area at 140 Cortland Avenue in the City of Syracuse and consists of two non-contiguous Site areas. The former main laundry facility and

RENALLI TAYLOR ST LLC (Continued) **1000311573**

offices are known as 140 Cortland Avenue (Tax Map No. 094.-05-06.0) and consist of one parcel of land totaling approximately 1.75 acres. The park and employee parking area are known as 1002-1022 South Salina Street/Cortland Avenue and 1024-1040 South Salina Street/Tallman Street and consists of two parcels totaling approximately 1.70 acres. The on-site limits are generally bound by commercial buildings to the north, South Salina Street to the east, Tallman Street to the south and South Clinton Street to the west. The off-site portion that currently needs investigation is approximately 8.5 acres located mainly to the west of the on-site portion. Site Features: 140 Cortland Ave. consists of the currently vacant former laundering facility and offices, sidewalks and limited vegetation. The building is a concrete block building with a slab-on-grade foundation. The other area consists of a small park and a fenced in asphalt parking lot. The off-site area is relatively flat and there are several buildings with both industrial and commercial use space. The area also consists of multiple parking lots and some green space. Current Zoning and Land Use: The on-site portion of the site is currently inactive and is zoned for commercial use. The off-site area is zoned for commercial and industrial use. Several rows of multifamily houses are located west of the area. Past Use of the Site: The 140 Cortland Avenue property was owned by various entities of Coyne Textile Services since the mid-1930s and was utilized as an industrial laundry prior to the company filing for bankruptcy and ceasing operations in late 2015. Dry cleaning using PCE and Stoddard solvent (a petroleum mixture made from distilled alkanes, cycloalkanes (naphthenes) and aromatic compounds) was conducted at the property until 2000. These dry cleaning products were stored in aboveground storage tanks (ASTs). Three underground storage tanks (USTs) were historically closed in place and were identified as being located beneath the dry cleaning room floor and the boiler room at 140 Cortland Avenue. A gasoline filling station was present in the southern portion of the Site in the 1980s. Prior to the Site being developed by Coyne Textile Services in the 1930s, the Site and surrounding area consisted primarily of single family residences. The former employee parking lot and park located east of the former laundering facility was owned by Coyne Textile Services from 1989-2015. Since 1989 this area was utilized as a parking lot and park. Historically, a building was utilized by the Syracuse Transit Corporation Bus Lines on the southern portion of the parking lot for bus storage and repairs from at least the 1940s to 1980s. The Syracuse Street Car barn also occupied this area in the early 1900s. The northern portion of the former employee parking lot and park was occupied by small stores in the early 1900s and a gasoline filling station was present on this portion of the parcel from at least the 1950s to 1970s. Coyne Textile Services filed for bankruptcy and ceased operations in late 2015. Ranalli/Taylor St. purchased the property in 2016 and entered a BCA in September 2017. The past use of most of the off-site area is currently unknown. But some of the area was used by Coyne Textile Services to park and maintain their truck fleet. Another portion of the area was used to manufacture garage door parts, faucets, and inked ribbon spools, clips and strips. Site Geology and Hydrogeology: Both the on-site and off-site areas sites have an approximate elevation of 390 feet above mean sea level and are relatively flat. The surrounding areas to the east and west have a relatively steep topographic gradient which slopes downward to Onondaga Creek. Soils consist of Urban Land with the bedrock

RENALLI TAYLOR ST LLC (Continued) **1000311573**

anticipated to be of Paleozoic era, stratified sequence. The bedrock geology underlying the Site is the Syracuse Formation, which consists of dolostone, shale, gypsum, and salts. The estimated depth to groundwater is less than 20 feet below ground surface. Groundwater at the sites is assumed to flow to the west toward Onondaga Creek. However, localized flow directions in the area of the sites may vary as a result of underground utilities or other heterogeneous subsurface conditions. Onondaga Creek is located approximately 600 feet west of the on-site portion, which flows in a northerly direction towards Onondaga Lake."

Env Problem:

"Nature and Extent of Contamination: On-site soil and groundwater were analyzed for volatile organic compounds (VOCs), semi-volatile compounds (SVOCs), metals, polychlorinated biphenyls (PCBs), and pesticides. Groundwater was also sampled for Emerging Contaminants (ECs). Soil vapor was analyzed for VOCs. Based upon investigations conducted to date, the primary contaminants of concern appear to be VOCs and metals with minor detection's of ECs, PCBs, and SVOCs. No off-site samples were taken during the on-site Remedial Investigation. However, there is some off-site groundwater data. See the Groundwater section below. Soil Surface Soils: Only one VOC, acetone, was detected in the surface soil sample collected from Coyne Park at a concentration of 0.427 ppm which exceeds the Part 375 Unrestricted SCO of 0.05 ppm but is less than the Part 375 Commercial SCO of 500 ppm. SVOCs, PCBs, metals, and pesticides contamination were not identified in the surface soil sample. There is currently no off-site surface soil data. Subsurface Soils: Only one VOC, Tetrachloroethene (PCE), was detected at a concentration exceeding the Part 375 Commercial SCO of 150 milligram per kilogram (mg/kg). The PCE concentration is 460mg/kg and this sample was located in the NW corner of the on-site building. There are several other compounds including 1,1- Dichloroethene at a maximum of 1.45mg/kg, 1,2,4 Trimethylbenzene at a maximum of 4.31mg/kg, 2-Butanone (MEK) at a maximum of 0.115mg/kg, trichloroethene at a maximum of 38.3mg/kg, vinyl chloride at a maximum of 12.3mg/kg, cis-1,2-Dichloroethene at a maximum of 424mg/kg, trans-1,2-Dichloroethene at a maximum of 3.46mg/kg, acetone at a maximum of 5.9mg/kg, and Benzene at a maximum of 0.39mg/kg, that were detected above Part 375 Unrestricted SCOs. SVOCs detected at concentrations exceeding their respective Part 375 Unrestricted SCOs, but below Part 375 Commercial SCOs, include benzo(a)anthracene at a maximum of 2.42mg/kg, Benzo(a)pyrene at a maximum of 2.28mg/kg, Benzo(b)fluoranthene at a maximum of 3.06mg/kg, Benzo(k)fluoranthene at a maximum of 1.64mg/kg, Chrysene at a maximum of 2.42mg/kg, and Indeno(1,2,3-cd)pyrene at a maximum of 0.79mg/kg. No SVOCs were detected at concentrations exceeding the Part 375 Commercial SCOs. Pesticides were not detected in any of the subsurface samples. PCBs, including Aroclor 1242 and Aroclor 1260 were detected at concentrations above their respective Part 375 Unrestricted SCO of 0.1 mg/kg, but below the Part 375 Commercial SCO. The maximum Total PCBs concentration was 0.74 mg/kg. Low concentrations of metals were found across the on-site area. Barium was detected at a concentration of 404 mg/kg, which exceeds the Part 375 Commercial SCO of 400 mg/kg. However, this value was qualified, by Pace, with a JH qualifier. This sample was located near the location of the former folding/product storage area. Several other metals were detected above unrestricted SCOs including copper at a maximum of 114mg/kg, lead at a maximum of 776mg/kg, nickel at a maximum of 56.2mg/kg, zinc at a maximum of 315mg/kg, and mercury at a

RENALLI TAYLOR ST LLC (Continued) **1000311573**

maximum of 1.4mg/kg. No offsite soil samples were taken during the RI however some off-site subsurface soils were sampled in 2015. Off-site subsurface soil data shows four SVOCs above Industrial SCOs in MW-4 at a depth of 8-10 feet. These SVOCs are Benzo(a)anthracene at a maximum of 20 mg/kg, Benzo(a)pyrene at a maximum of 17 mg/kg, Benzo(b)fluoranthene at a maximum of 21 mg/kg, and Dibenzo(a,h)anthracene at a maximum of 2.4 mg/kg. No other contaminants were above industrial SCOs. Groundwater (GW) No PCBs or Pesticides were detected within the groundwater. VOCs detected in groundwater above the GW standard include 1,1-Dichloroethene at a maximum of 18ug/kg, benzene at a maximum of 104ug/kg, isopropylbenzene (Cumene) at a maximum of 121ug/kg, tetrachloroethene at a maximum of 21,400ug/kg, trichloroethene at a maximum of 1,980ug/kg, vinyl chloride at a maximum of 1,560ug/kg, xylene (Total) at a maximum of 6.3ug/kg, cis-1,2-Dichloroethene at a maximum of 4,550ug/kg, and trans-1,2-Dichloroethene at a maximum of 27.5ug/kg. Most of the VOC GW impacts were located in the NW portion of the on-site building but VOC impacts were detected throughout the site. Only one SVOC exceeded GW standards and that was bis(2-Ethylhexyl)phthalate at a maximum of 11ug/kg. This was located in the NW portion of the on-site building. Metals that exceeded the GW standards include barium at a maximum of 2.940ug/kg, beryllium at a maximum of 7ug/kg, chromium at a maximum of 55ug/kg, copper at a maximum of 1,120ug/kg, lead at a maximum of 27ug/kg, magnesium at a maximum of 204,000ug/kg, and thallium at a maximum of 14.5ug/kg. Metals within the GW were detected throughout the whole site. ECs detected in the GW include 6:2FTS at a maximum of 33ng/kg, Perfluorobutanesulfonic acid (PFBS) at a maximum of 14ng/kg, Perfluorobutanoic acid (PFBA) at a maximum of 330ng/kg, Perfluorodecanoic acid (PFDA) at a maximum of 2.1ng/kg, Perfluoroheptanesulfonic Acid (PFHpS) at a maximum of 24ng/kg, Perfluoroheptanoic acid (PFHpA) at a maximum of 160ng/kg, Perfluorohexanesulfonic acid (PFHxS) at a maximum of 25ng/kg, Perfluorohexanoic acid (PFHxA) at a maximum of 350ng/kg, Perfluorononanoic acid (PFNA) at a maximum of 75ng/kg, Perfluorooctanesulfonic acid (PFOS) at a maximum of 2,000ng/kg, Perfluorooctanoic acid (PFOA) at a maximum of 300ng/kg, Perfluoropentanoic acid (PFPeA) at a maximum of 360ng/kg, and 1,4-Dioxane at a maximum of 1.7ng/kg. Most of the ECs were detected in the NW portion of the on-site building. No off-site wells were sampled during the remedial investigation. However, off-sites wells were sampled previously in 2015. There are 4 monitoring wells off-site located to the northwest of the on-site area. Each of these wells have contaminants that exceed NYSDEC TOGS 1.1.1 water quality standards and guidance values. The following contaminants were detected above the GW standards at one or more of the wells: Tetrachloroethene at a maximum of 3100ug/L, benzene at a maximum of 4.4ug/L, vinyl chloride at a maximum of 3200ug/L, trans-1,2-dichloroethene at a maximum of 230ug/L, Trichloroethene at a maximum of 2000ug/L, cis-1,2-dichloroethene at a maximum of 5600ug/kg, and 1,1-Dichloroethene at a maximum of 15ug/L. Soil Vapor Soil vapor detection's that need additional action were detected all throughout the on-site building. Compounds detected needing additional action include: 1,1,1 - Trichloroethane at a maximum of 5.3ug/m3, Tetrachloroethene at a maximum of 1,090ug/m3, Trichloroethene at a maximum of 106ug/m3, and cis-1,2-Dichloroethene at a maximum of 38.4ug/m3. There is currently no off-site soil vapor

RENALLI TAYLOR ST LLC (Continued) **1000311573**

	data. "
Health Problem:	"Volatile organic compounds in groundwater or soil vapor originating from the Former Coyne Textile site (C734144) may move off-site into overlying buildings and affect indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Investigations are needed to determine if soil vapor intrusion is a potential concern for these off-site buildings."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2019-01-02 13:58:00
Record Upd:	2019-01-02 13:58:00
Updated By:	MJBELVEG
Own Op:	Not reported
Sub Type:	Not reported
Owner Name:	Not reported
Owner Company:	Not reported
Owner Address:	Not reported
Owner Addr2:	Not reported
Owner City,St,Zip:	Not reported
Owner Country:	Not reported
HW Code:	C734144A
Waste Type:	benzo(a)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	benzo(b)fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	dibenz[a,h]anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	benzene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	trans-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	cis-1,2-dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Waste Type:	1,1 dichloroethene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	trichloroethene (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	vinyl chloride
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C734144A
Waste Type:	benzo(a)anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	C734144
Cross Ref Type Code:	22
Cross Ref Type:	BCP Site ID
Record Added Date:	2019-01-02 13:56:00
Record Updated:	2019-01-02 13:56:00
Updated By:	MJBELVEG

SPILLS:

Name:	COYNE TEXTILE SERVICES
Address:	140 CORTLAND ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9909798 / 1999-11-30
Facility ID:	9909798
Facility Type:	ER
DER Facility ID:	65005
Site ID:	68200
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	1999-11-12
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1999-11-12
CID:	211
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1999-11-12
Spill Record Last Update:	2000-02-15
Spiller Name:	D J SMITH
Spiller Company:	COYNE TEXTILE SERVICES
Spiller Address:	140 CORTLAND ST
Spiller Company:	001
Contact Name:	D J SMITH
Latitude:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	2 CAUSES FAILED LEVEL CONTROL VALVE AND OVER FLOW PIPE BROKE - SPILL CLEANED UP

All Materials:

Site ID:	68200
Operable Unit ID:	1088487
Operable Unit:	01
Material ID:	298867
Material Code:	0060A
Material Name:	wastewater
Case No.:	Not reported
Material FA:	Other
Quantity:	100.00
Units:	G
Recovered:	100.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	COMMERCIAL BUILDING (COYNE TEXTILE)
Address:	140 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	0905092 / 2010-01-12
Facility ID:	0905092
Facility Type:	ER
DER Facility ID:	366482
Site ID:	417341
DEC Region:	7
Spill Cause:	Housekeeping
Spill Class:	C6
SWIS:	3415
Spill Date:	2009-08-01
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2009-08-01
CID:	Not reported
Water Affected:	ONONDAGA CREEK
Spill Source:	Non Major Facility > 1,100 gal
Spill Notifier:	Fire Department
Cleanup Ceased:	2009-08-03
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-08-01
Spill Record Last Update:	2010-01-12
Spiller Name:	Not reported
Spiller Company:	COYNE TEXTILE
Spiller Address:	140 CORTLAND AVE
Spiller Company:	999
Contact Name:	CHIEF DUFFY
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	FD advised 2 40 CY ISO containers caught fire due to suspected spontaneous combustion of oily rags

RENALLI TAYLOR ST LLC (Continued) **1000311573**

stored inside. FD used several thousand gallons of water to extinguish fire, causing oily surface
water to flow into area storm drains. Awaiting FD report from Lt. Galloway.

Remarks: 2 large containers found with rags soaked with engine oil,cooking oil,auto grease, and printer ink caught on fire.Request DEC call back.
Not reported

All Materials:

Site ID: 417341
Operable Unit ID: 1173560
Operable Unit: 01
Material ID: 2165500
Material Code: 0046A
Material Name: cooking grease
Case No.: Not reported
Material FA: Other
Quantity: Not reported
Units: G
Recovered: Not reported
Resource Affected: Soil, Surface Water
Oxygenate: Not reported

Site ID: 417341
Operable Unit ID: 1173560
Operable Unit: 01
Material ID: 2165501
Material Code: 0064A
Material Name: unknown material
Case No.: Not reported
Material FA: Other
Quantity: Not reported
Units: G
Recovered: Not reported
Resource Affected: Soil, Surface Water
Oxygenate: Not reported

Name: COYNE TEXTILE SERVICES
Address: 140 CORTLAND AVE
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 0301230 / 2003-05-05
Facility ID: 0301230
Facility Type: ER
DER Facility ID: 132732
Site ID: 101722
DEC Region: 7
Spill Cause: Other
Spill Class: C6
SWIS: 3415
Spill Date: 2003-05-04
Investigator: MENASH
Referred To: Not reported
Reported to Dept: 2003-05-04
CID: 365
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2003-05-04
Spill Record Last Update:	2003-05-05
Spiller Name:	DJ SMITH
Spiller Company:	COYNE TEXTILE SERVICES
Spiller Address:	140 CORTLAND AV
Spiller Company:	001
Contact Name:	DJ SMITH
Latitude:	43.0372833
Longitude:	-76.1502534
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MN SPILL TURNED OVER TO WATER DEPT.
Remarks:	spontainious heating caused a fire in the facility - the fire dept responded - oils inks & blanket wash & water put on the fire by fd were washed down the storm sewer

All Materials:

Site ID:	101722
Operable Unit ID:	867623
Operable Unit:	01
Material ID:	571447
Material Code:	0064A
Material Name:	unknown material
Case No.:	Not reported
Material FA:	Other
Quantity:	1200.00
Units:	G
Recovered:	.00
Resource Affected:	Sewer
Oxygenate:	Not reported

Name:	CONSTRUCTION SITE
Address:	140 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2005960 / 2020-10-29
Facility ID:	2005960
Facility Type:	ER
DER Facility ID:	132732
Site ID:	611773
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	3415
Spill Date:	2020-09-30
Investigator:	MJBELVEG
Referred To:	Not reported
Reported to Dept:	2020-10-01
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Other

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2020-10-01
Spill Record Last Update:	2020-10-29
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	KARYN MEHMANN
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	cleanup pending brownfield cleanup number c734144

All Materials:

Site ID:	611773
Operable Unit ID:	1358921
Operable Unit:	01
Material ID:	2370364
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Groundwater
Oxygenate:	Not reported

RCRA Listings:

Date Form Received by Agency:	20160302
Handler Name:	Coyne Textile Services
Handler Address:	Cortland Ave
Handler City,State,Zip:	SYRACUSE, NY 13221
EPA ID:	NYD013250618
Contact Name:	JOHN D WESSELS
Contact Address:	CORTLAND AVE
Contact City,State,Zip:	SYRACUSE, NY 13221
Contact Telephone:	315-475-1626
Contact Fax:	315-475-0057
Contact Email:	JOHN.WESSELS@COYNETEXTILESERVICES.COM
Contact Title:	CORPORATE ENVIRONMENTAL AFFAIRS
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	CORTLAND AVE

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Mailing City,State,Zip:		SYRACUSE, NY 13221
Owner Name:	Coyne International Enterprises	
Owner Type:		Private
Operator Name:	Coyne Textile Services	
Operator Type:		Private
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
202 GPRA Corrective Action Baseline:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No
Addressed Significant Non-Complier Universe:		No
Significant Non-Complier With a Compliance Schedule Universe:		No
Financial Assurance Required:		Not reported
Handler Date of Last Change:		20160323
Recognized Trader-Importer:		No
Recognized Trader-Exporter:		No
Importer of Spent Lead Acid Batteries:		No
Exporter of Spent Lead Acid Batteries:		No
Recycler Activity Without Storage:		No
Manifest Broker:		No
Sub-Part P Indicator:		No

Biennial: List of Years
Year: 2015

Click Here for Biennial Reporting System Data:
Year: 2013

Click Here for Biennial Reporting System Data:
Year: 2011

Click Here for Biennial Reporting System Data:
Year: 2009

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Click Here for Biennial Reporting System Data:
Year: 2007

Click Here for Biennial Reporting System Data:
Year: 2005

Click Here for Biennial Reporting System Data:
Year: 2003

Click Here for Biennial Reporting System Data:
Year: 2001

Click Here for Biennial Reporting System Data:

Hazardous Waste Summary:
Waste Code: D001
Waste Description: Ignitable Waste

Waste Code: D008
Waste Description: Lead

Waste Code: D018
Waste Description: Benzene

Waste Code: D039
Waste Description: Tetrachloroethylene

Waste Code: D040
Waste Description: Trichloroethylene

Waste Code: F002
Waste Description: The Following Spent Halogenated Solvents: Tetrachloroethylene, Methylene Chloride, Trichloroethylene, 1,1,1-Trichloroethane, Chlorobenzene, 1,1,2-Trichloro-1,2,2-Trifluoroethane, Ortho-Dichlorobenzene, Trichlorofluoromethane, And 1,1,2, Trichloroethane; All Spent Solvent Mixtures/Blends Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Halogenated Solvents Or Those Solvents Listed In F001, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.

Handler - Owner Operator:
Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE TEXTILE SERVICES
Legal Status: Private
Date Became Current: 19390524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Owner/Operator Name: STANLEY COYNE INT ENTERPRISES CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-475-1626
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE TEXTILE SERVICES
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE TEXTILE SERVICES
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES
Legal Status: Private
Date Became Current: 19390524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: 315-475-1626
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE TEXTILE SERVICES
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE TEXTILE SEVICES
Legal Status: Federal
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES, INC.
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES
Legal Status: Private
Date Became Current: 19390524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: 315-475-1626
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE TEXTILE SERVICES
Legal Status: Private
Date Became Current: 20021121
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13202

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE TEXTILE SEVICESCOYNE INTERNATIONAL
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE TEXTILE SERVICES
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: NO NAME FOUND
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES
Legal Status: Private
Date Became Current: 19290524

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE TEXTILE SERVICES
Legal Status: Private
Date Became Current: 19390524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: STANLEY COYNE INT ENTERPRISES CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-475-1626
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES, INC.
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE TEXTILE SERVICES
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES, INC.
Legal Status: Private
Date Became Current: 19290524
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE.
Owner/Operator City,State,Zip: SYRACUSE, NY 13221
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20100219
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20120223
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20140314
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20160208
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060215
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20160302
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19930412
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Electronic Manifest Broker: Not reported

Receive Date: 20021121
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19900301
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920228
Handler Name: COYNE TEXTILE
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19940516
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19960222
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator

RENALLI TAYLOR ST LLC (Continued) **1000311573**

State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19980211
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20010101
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20020207
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20040216
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060216
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080126
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 812332
NAICS Description: Industrial Launderers

Has the Facility Received Notices of Violations:
Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number:Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Universal Waste - Small Quantity Handlers
Date Violation was Determined:	20070830
Actual Return to Compliance Date:	20071015
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20070920
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYJGE
Enforcement Responsible Sub-Organization:	R7
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - General
Date Violation was Determined:	19901116
Actual Return to Compliance Date:	19910114
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19910110
Enforcement Identifier:	002
Date of Enforcement Action:	19901210
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDEC
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Generators - Manifest
Date Violation was Determined: 19880104
Actual Return to Compliance Date: 19880106
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 19880106
Enforcement Identifier: 001
Date of Enforcement Action: 19880104
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDEC
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number:Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:
Evaluation Date: 20140812
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier: NYBRS
Evaluation Responsible Sub-Organization: R7
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20120201
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier: R2OSK
Evaluation Responsible Sub-Organization: RCB

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20100504
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier:	NYJGE
Evaluation Responsible Sub-Organization:	R7
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20070830
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier:	NYJGE
Evaluation Responsible Sub-Organization:	R7
Actual Return to Compliance Date:	20071015
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20030609
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier:	NYBRS
Evaluation Responsible Sub-Organization:	R7
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19991223
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier:	NYBRS
Evaluation Responsible Sub-Organization:	R7
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Former Citation:	Not reported
Evaluation Date:	19901116
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19910114
Scheduled Compliance Date:	19910110
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19880104
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19880106
Scheduled Compliance Date:	19880106
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19870910
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

ICIS:

Enforcement Action ID:	NY000A0000731150034200304
FRS ID:	110000807431
Action Name:	COYNE TEXTILE SERVICES 360670009900304
Facility Name:	COYNE TEXTILE SERVICES
Facility Address:	140 CORTLAND AVE SYRACUSE, NY 132023411
Enforcement Action Type:	Notice of Violation
Facility County:	ONONDAGA
Program System Acronym:	AIR
Enforcement Action Forum Desc:	Administrative - Informal
EA Type Code:	NOV
Facility SIC Code:	7218
Federal Facility ID:	Not reported
Latitude in Decimal Degrees:	43.037514

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Longitude in Decimal Degrees: -76.150328
Permit Type Desc: Not reported
Program System Acronym: NY0000007311500342
Facility NAICS Code: 812320
Tribal Land Code: Not reported

Enforcement Action ID: NY000A0000731150034200007
FRS ID: 110000807431
Action Name: COYNE TEXTILE SERVICES 360670009900007
Facility Name: COYNE TEXTILE SERVICES
Facility Address: 140 CORTLAND AVE
SYRACUSE, NY 132023411
Enforcement Action Type: Administrative Order
Facility County: ONONDAGA
Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCAAAO
Facility SIC Code: 7218
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 43.037514
Longitude in Decimal Degrees: -76.150328
Permit Type Desc: Not reported
Program System Acronym: NY0000007311500342
Facility NAICS Code: 812320
Tribal Land Code: Not reported

Enforcement Action ID: NY000A0000731150034200005
FRS ID: 110000807431
Action Name: COYNE TEXTILE SERVICES 360670009900005
Facility Name: COYNE TEXTILE SERVICES
Facility Address: 140 CORTLAND AVE
SYRACUSE, NY 132023411
Enforcement Action Type: Notice of Violation
Facility County: ONONDAGA
Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: NOV
Facility SIC Code: 7218
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 43.037514
Longitude in Decimal Degrees: -76.150328
Permit Type Desc: Not reported
Program System Acronym: NY0000007311500342
Facility NAICS Code: 812320
Tribal Land Code: Not reported

US AIRS MINOR:
Envid: 1000311573
Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
D and B Number: Not reported
Primary SIC Code: 7218
NAICS Code: 812320
Default Air Classification Code: MIN
Facility Type of Ownership Code: POF

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Air CMS Category Code: Not reported
HPV Status: Not reported

US AIRS MINOR:
Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: Not reported
Activity Status Date: 1999-11-10 00:00:00
Activity Group: Case File
Activity Type: Case File
Activity Status: Resolved

Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 1999-03-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 1999-11-10 00:00:00
Activity Status Date: 1999-11-10 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Formal
Activity Status: Final Order Issued

Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 1999-04-02 00:00:00
Activity Status Date: 1999-04-02 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Informal
Activity Status: Achieved

Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: MACT Standards (40 CFR Part 63)

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Activity Date: 2002-12-10 00:00:00
Activity Status Date: 2002-12-10 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Informal
Activity Status: Achieved

Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1984-10-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000007311500342
Facility Registry ID: 110000807431
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1999-12-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

FINDS:
Registry ID: 110070913211

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.
Registry ID: 110000807431

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
All generators and treatment, storage, and disposal (TSD) facilities who handle hazardous waste are required to report to the EPA Administrator at least once every two years. The data collected is used to create the National Biennial Resource Conservation and Recovery Act (RCRA) Hazardous Waste Report. This data is processed within the RCRA Information (RCRAInfo) database
The Air Facility System (AFS) contains compliance and permit data for stationary sources of air pollution regulated by the EPA, state, and local air pollution agencies.
ICIS-Air (AIR) AIR is the modernization of the Air Facility System

RENALLI TAYLOR ST LLC (Continued) **1000311573**

(AFS) into the Integrated Compliance Information System (ICIS). AIR contains enforcement, compliance, and permit data for stationary sources of air pollution regulated by the EPA, State, and Local air pollution agencies.
The New York Department of Environmental Conservation Facility Information System (FIS) database houses all information about facilities that are regulated or of environmental interest to the state of New York.
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1000311573
Registry ID:	110000807431
DFR URL:	
Name:	COYNE TEXTILE SERVICES
Address:	140 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY 13202

PFAS ECHO:

Facility ID:	110070913211
Name:	Renalli Taylor St Llc
Address:	140 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY 13202
Latitude:	43.03709
Longitude:	-76.15031
Count:	1
County:	ONONDAGA
Status:	Inactive
Region:	02
Industry:	Electronics Industry

ECHO Facility Report:

Facility Percent Minority:	46.285
Facility Derived Tribes:	Onondaga Nation - 5 mile(s), Oneida Indian Nation - 10 mile(s)
Facility Population:	5165.42
EPA Programs:	RCRA
Federal Facility:	No
Federal Agency:	-
Facility FIPS Code:	36067
Facility Indian Country Flag:	N
Facility Collection Method:	ADDRESS MATCHING-HOUSE NUMBER
Facility Derived HUC:	04140201
Facility Derived WBD:	041402011507
Facility Derived CD113:	24
Facility Derived CB2010:	360670042002018
Facility Major Flag:	-
Facility Active Flag:	-
Facility Inspection Count:	0

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Facility Date Last Inspection:	-
Facility Days Last Inspection:	-
Facility Informal Count:	0
Facility Date Last Informal Action:	-
Facility Formal Action Count:	0
Facility Date Last Formal Action:	-
Facility Total Penalties:	0
Facility Penalty Count:	-
Facility Date Last Penalty:	-
Facility Last Penalty AMT:	-
Facility QTRS With NC:	0
Facility Programs With SNC:	0
Facility Compliance Status:	No Violation Identified
Facility SNC Flag:	N
AIR Flag:	N
NPDES Flag:	N
SDWIS Flag:	N
RCRA Flag:	Y
TRI Flag:	N
GHG Flag:	N
AIR IDS:	-
CAA Permit Types:	-
CAA NAICS:	-
CAA SICS:	-
NPDES IDS:	-
CWA Permit Types:	-
CWA NAICS:	-
CWA SICS:	-
RCRA IDS:	NYR000247932
RCRA Permit Types:	Other
RCRA NAICS:	334220
SDWA IDS:	-
SDWA System Types:	-
SDWA Compliance Status:	-
SDWA SNC Flag:	N
TRI IDS:	-
TRI Releases Transfers:	-
TRI On Site Releases:	-
TRI Off Site Transfers:	-
TRI Reporter:	-
Facility IMP Water Flag:	-

DRYCLEANERS:

Name:	COYNE TEXTILE SERVICES
Address:	140 CORTLAND AVE.
City,State,Zip:	SYRACUSE, NY 13202
Facility ID:	7-3115-00342
Phone Number:	315-475-1626
Region:	Not reported
Registration Effective Date:	12/2/1999 0:00
Inspection Date:	09/16/2012
Install Date:	99/16
Expiration Date:	Not reported
Removal Date:	Not reported
Drop Shop:	Not reported
Shutdown:	Y
Alternate Solvent:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Current Business: Not reported

NY MANIFEST:

EPA ID:	NYR000247932
Country:	USA
Name:	Renalli Taylor St Llc
Address:	140 CORTLAND AVE
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	140 CORTLAND AVE
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Renalli Taylor St Llc
Mailing Contact:	Renalli Taylor St Llc
Mailing Address 1:	140 CORTLAND AVE
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2155807192

EPA ID:	NYD013250618
Country:	USA
Name:	Coyne Textile Services
Address:	140 CORLAND AVE
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13221
Zip 4:	Not reported
Location Address 1:	140 CORTLAND AVE
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13221
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Coyne Textile Services
Mailing Contact:	Ed Brewer
Mailing Address 1:	140 CORTLAND AVENUE
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13221
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154751626

Manifest Data:

Document ID:	NYC1051187
Manifest Status:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Trans1 State ID:	NYNS7863
Year:	1991
Trans2 State ID:	Not reported
Generator Ship Date:	06/24/1991
Trans1 Recv Date:	06/24/1991
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/24/1991
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD000824581
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	The Following Spent Halogenated Solvents: Tetrachloroethylene, Methylene Chloride, Trichloroethylene, 1,1,1-Trichloroethane, Chlorobenzene, 1,1,2-Trichloro-1,2,2-Trifluoroethane, Ortho-Dichlorobenzene, Trichlorofluoromethane, And 1,1,2, Trichloroethane; All Spent Solvent Mixtures/Blends Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Halogenated Solvents Or Those Solvents Listed In F001, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	01950
Units:	Pounds
Number of Containers:	010
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYC3058604
Manifest Status:	Not reported
Trans1 State ID:	NYLJ5601
Year:	1994
Trans2 State ID:	Not reported
Generator Ship Date:	06/03/1994
Trans1 Recv Date:	06/03/1994
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/06/1994
Part A Recv Date:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD982743312
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	The Following Spent Halogenated Solvents: Tetrachloroethylene, Methylene Chloride, Trichloroethylene, 1,1,1-Trichloroethane, Chlorobenzene, 1,1,2-Trichloro-1,2,2-Trifluoroethane, Ortho-Dichlorobenzene, Trichlorofluoromethane, And 1,1,2, Trichloroethane; All Spent Solvent Mixtures/Blends Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Halogenated Solvents Or Those Solvents Listed In F001, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00585
Units:	Pounds
Number of Containers:	003
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG2914911
Manifest Status:	Not reported
Trans1 State ID:	CT9751
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	07/27/2001
Trans1 Recv Date:	07/27/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/30/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	The Following Spent Nonhalogenated Solvents: Xylene, Acetone, Ethyl Acetate, Ethyl Benzene, Ethyl Ether, Methyl Isobutyl Ketone, N-Butyl Alcohol, Cyclohexanone, And Methanol; All Spent Solvent Mixtures/Blends Containing, Before Use, Only The Above Spent Nonhalogenated Solvents; And All Spent Solvent Mixtures/Blends Containing, Before Use, One Or More Of The Above Nonhalogenated Solvents, And A Total Of Ten Percent Or More (By Volume) Of One Or More Of Those Solvents Listed In F001, F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	34700
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG2915415
Manifest Status:	Not reported
Trans1 State ID:	CTV35108
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	09/05/2001
Trans1 Recv Date:	09/05/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/06/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	42560
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYC1106223
Manifest Status:	Not reported
Trans1 State ID:	NYNS7863
Year:	1991
Trans2 State ID:	Not reported
Generator Ship Date:	07/22/1991
Trans1 Recv Date:	07/22/1991
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/22/1991
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD000824581
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	The Following Spent Halogenated Solvents: Tetrachloroethylene, Methylene Chloride, Trichloroethylene, 1,1,1-Trichloroethane, Chlorobenzene, 1,1,2-Trichloro-1,2,2-Trifluoroethane, Ortho-Dichlorobenzene, Trichlorofluoromethane, And 1,1,2, Trichloroethane; All Spent Solvent Mixtures/Blends Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Halogenated Solvents Or Those Solvents Listed In F001, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Waste Code 6:	Not reported
Quantity:	02730
Units:	Pounds
Number of Containers:	014
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYG2915928
Manifest Status:	Not reported
Trans1 State ID:	V17860CT
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	08/15/2001
Trans1 Recv Date:	08/15/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/15/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	37680
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00
Document ID:	NYG2912184
Manifest Status:	Not reported
Trans1 State ID:	S9751CT
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	04/05/2001
Trans1 Recv Date:	04/05/2001
Trans2 Recv Date:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

TSD Site Recv Date:	04/05/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	43160
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG2912445
Manifest Status:	Not reported
Trans1 State ID:	CTV35108
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	04/19/2001
Trans1 Recv Date:	04/19/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/19/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	42640
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG2913138
Manifest Status:	Not reported
Trans1 State ID:	V17860CT
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	05/14/2001
Trans1 Recv Date:	05/14/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/14/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	37500
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Document ID:	NYG2913381
Manifest Status:	Not reported
Trans1 State ID:	S9751CT
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	05/29/2001
Trans1 Recv Date:	05/29/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/29/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD080469935
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	38120
Units:	Pounds
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYG2914191
Manifest Status:	Not reported
Trans1 State ID:	CTV35108
Year:	2001
Trans2 State ID:	Not reported
Generator Ship Date:	06/25/2001
Trans1 Recv Date:	06/25/2001
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/26/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD013250618
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	CTD021816889
TSDF ID 2:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	05000
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Burn
Specific Gravity:	01.00

Click this hyperlink while viewing on your computer to access
1075 additional NY MANIFEST: record(s) in the EDR Site Report.

RI MANIFEST:

Name:	Not reported
Address:	140 CORTLAND
City,State,Zip:	SYRACUSE, NY 13221-0000
EPA Id:	NYD013250618
GEN Cert Date:	4/10/1997
Manifest Document Number:	CTF0386557
Waste Description:	FLAM LIQ
TSDF Id:	CTD021816889
TSDF Name:	UNITED OIL RECOVERY INC
Qty:	5250
WT/Vol Units:	G
TSDF Date:	Not reported
Transporter 2 Id:	Not reported
Item Number:	1
Transporter 2 Name:	Not reported
Transporter Name 2:	UNITED IND SVS
Transporter EPAID:	CTD021816889
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	D001
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Fee Exempt Code:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Comment:	Not reported
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
Quarter:	Not reported
Transporter Contact Name:	Not reported
Transporter Contact Email:	Not reported
Filing Date:	Not reported
Total Fee:	Not reported
Billing Name:	Not reported
Paid Date:	Not reported
Paid Time:	Not reported
Facility Receipt Date:	Not reported
Fee:	Not reported
Manifest Created Date:	Not reported
Manifest Updated Date:	Not reported

RI MANIFEST:

Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	D001
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	UNITED OIL RECOVERY INC
TSDF Id:	CTD021816889
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NYD013250618
Manifest Docket Number:	CTF0386557
Quarter:	Not reported
Waste Description:	FLAM LIQ
Transporter Contact Name:	Not reported
Quantity:	5250
Transporter Contact Email:	Not reported
WT/Vol Units:	G
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	UNITED IND SVS
Billing Name:	Not reported
Transporter EPA ID:	CTD021816889
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	4/10/1997
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported

RENALLI TAYLOR ST LLC (Continued) **1000311573**

Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	D001
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	UNITED OIL RECOVERY INC
TSDF Id:	CTD021816889
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NYD013250618
Manifest Docket Number:	CTF0386557
Quarter:	Not reported
Waste Description:	FLAM LIQ
Transporter Contact Name:	Not reported
Quantity:	5250
Transporter Contact Email:	Not reported
WT/Vol Units:	G
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	UNITED IND SVS
Billing Name:	Not reported
Transporter EPA ID:	CTD021816889
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	4/10/1997
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported

W98 **MARATHON WATER SUPPLY** **NY LTANKS** **S100153235**
NNW **MARATHON SCHOOL BUS GARAG** **N/A**
1/4-1/2 **MARATHON, NY**
0.312 mi.
1646 ft. **Site 1 of 2 in cluster W**

Relative: **Lower**
Actual: **397 ft.**

LTANKS:

Name:	MARATHON WATER SUPPLY
Address:	MARATHON SCHOOL BUS GARAG
City,State,Zip:	MARATHON, NY
Spill Number/Closed Date:	9104876 / 1996-04-22
Facility ID:	9104876
Site ID:	64963
Spill Date:	1991-07-09
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other

MARATHON WATER SUPPLY (Continued) **S100153235**

Spill Class:	A3
Cleanup Ceased:	Not reported
SWIS:	1234
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1991-08-06
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Health Department
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1991-08-06
Spill Record Last Update:	1996-05-31
Spiller Name:	Not reported
Spiller Company:	MARATHON CENTRAL SCHOOL
Spiller Address:	MAIN ST.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	62505
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 08/06/91: VISITED SITE W/D.VOLLMER. VERBAL NOTIFICATION TO SCHOOL SUPER LARRY HAYES THAT GROUNDWATER STUDY IS LIKELY. 08/30/91: WELLS INSTALLED AND SAMPLED AT SITE. CONTAMINATED SOIL BEING EXCAVATED AND STAGED ON SITE IN ATTEMPT TO MINIMIZE FURTHER MIGRATION OF EXISTING PLUME. 11/12/91: SAMPLE ANALYSIS FROM MONITORING WELLS INSTALLED.NEARLY ALL WELLS FREE OF CONTAMINATION. 02/12/92: SCHOOL DISTRICT HAS TAKEN OVER CLEANUP AND MONITORING. NO FURTHER STATE FUNDS TO BE EXPENDED. 04/22/96 REC'D LETTER FROM VILLAGE STATINGTHAT THE BACKUP WELL IS NO LONGER BEING USED AS PART OF VILLAGE WATER SYSTEM.
Remarks:	PUBLIC WELL CONTAMINATED WITH LOW LEVEL OF BTX.

All Materials:

Site ID:	64963
Operable Unit ID:	958928
Operable Unit:	01
Material ID:	423930
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	30.00
Units:	G
Recovered:	25.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

U99 **CLARK HALL; CROUSE IRVIN.** **NY LTANKS** **S100129395**
NE **ELIZABETH BLACKWELL ST** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.314 mi.
1659 ft. **Site 2 of 2 in cluster U**

Relative:
Higher

Actual:
419 ft.

LTANKS:

Name:	CLARK HALL; CROUSE IRVIN.
Address:	ELIZABETH BLACKWELL ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8709940 / 1988-04-12
Facility ID:	8709940
Site ID:	114725
Spill Date:	1988-02-18
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1988-04-12
SWIS:	3415
Investigator:	CSCUIPLY
Referred To:	Not reported
Reported to Dept:	1988-02-18
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1988-03-07
Spill Record Last Update:	1988-05-12
Spiller Name:	Not reported
Spiller Company:	CROUSE IRVING HOSPITAL
Spiller Address:	IRVING AVE.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	100049
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CC 02/22/88: TANKS PULLED ON 02/19/88. EXPLOSIVE VAPORS PERSIST. 04/12/88: TANKS: CONTAMINATED SOIL REMOVED. DISCHARGE INTO STORM SEWER SUBSIDED.
Remarks:	FAILURE RATE +.279 GPH

All Materials:

Site ID:	114725
Operable Unit ID:	914871
Operable Unit:	01
Material ID:	461729
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported

CLARK HALL; CROUSE IRVIN. (Continued) **S100129395**

Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

X100 **MONDO'S AGWAY** **UST FINDER RELEASE** **1029068240**
SW **1127 SO. SALINA ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.320 mi.
1688 ft. **Site 1 of 6 in cluster X**

Relative: **Lower**
Actual: **390 ft.**

UST FINDER RELEASE:

Object ID:	249464
Facility ID:	NY244120
Lust ID:	NY8403634
Name:	MONDO'S AGWAY
Address:	1127 SO. SALINA ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1985/03/25 16:00:00+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1504
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.14947
Y Coord:	43.0361
Latitude:	43.0360999999999
Longitude:	-76.1494699999999

X101 **1127 SOUTH SALINA SYRACUSE LLC** **NY LTANKS** **U003313095**
SW **1127 SOUTH SALINA ST** **NY UST** **N/A**
1/4-1/2 **SYRACUSE, NY 13202** **NY Spills**
0.320 mi.
1688 ft. **Site 2 of 6 in cluster X**

Relative: **Lower**

Actual: **390 ft.**

LTANKS:

Name:	MONDO'S AGWAY
Address:	1127 SO. SALINA ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8403634 / 1991-06-17
Facility ID:	8403634
Site ID:	302125
Spill Date:	1985-03-25
Spill Cause:	Tank Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	C3
Cleanup Ceased:	1991-06-17
SWIS:	3415
Investigator:	GREGG
Referred To:	Not reported
Reported to Dept:	1985-03-25
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Police Department
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	1993-11-19
Spiller Name:	Not reported
Spiller Company:	EDWARD MONDO
Spiller Address:	341 SO. COLLINGWOOD AVE.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	244120
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was TG 06/14/89: CHECKED WELLS WITH J. SEITZ. FREE PRODUCT IN ALL 3 WELLS. 07/10/89: INTERIM ISR GIVEN TO REGIONAL ATTORNEY. MET WITH MR. MONDO AND HE IS HIRING A CONSULTANT TO DO A PHASE I HYDROGEO STUDY. 04/20/91: SITE VISIT TO BE PERFORMED TO CHECK LEVELS IN WELLS AND TO TALK WITH SPILLER. 06/17/91: ALL FREE PRODUCT REMOVED.
Remarks:	LOST 250 GAL. TANK BEING REMOVED FOUND PRODUCT.

All Materials:

Site ID:	302125
Operable Unit ID:	896071
Operable Unit:	01
Material ID:	482430
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum

1127 SOUTH SALINA SYRACUSE LLC (Continued) **U003313095**

Quantity: 250.00
Units: G
Recovered: 190.00
Resource Affected: Groundwater
Oxygenate: Not reported

UST:
Name: 1127 SOUTH SALINA SYRACUSE LLC
Address: 1127 SOUTH SALINA ST
City,State,Zip: SYRACUSE, NY 13202
Id/Status: 7-042161 / Active
Program Type: PBS
Region: STATE
DEC Region: 7
Expiration Date: 11/15/2029
UTM X: 406397.85388
UTM Y: 4765415.76441
Site Type: Retail Gasoline Sales

Affiliation Records:
Site Id: 44246
Affiliation Type: Facility Operator
Company Name: 1127 SOUTH SALINA SYRACUSE LLC
Contact Type: Not reported
Contact Name: 1127 SOUTH SALINA SYRACUSE LLC
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (315) 475-7434
EMail: Not reported
Fax Number: Not reported
Modified By: DJLASALL
Date Last Modified: 2024-12-23

Site Id: 44246
Affiliation Type: Emergency Contact
Company Name: 1127 SOUTH SALINA SYRACUSE LLC
Contact Type: Not reported
Contact Name: SYED KIRMANI
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 501-4364
EMail: Not reported
Fax Number: Not reported
Modified By: DJLASALL
Date Last Modified: 2024-12-23

Site Id: 44246
Affiliation Type: Mail Contact

1127 SOUTH SALINA SYRACUSE LLC (Continued) **U003313095**

Company Name:	1127 SOUTH SALINA SYRACUSE LLC
Contact Type:	PRESIDENT
Contact Name:	SYED KIRMANI
Address1:	26 MILL PLAIN RD
Address2:	Not reported
City:	DANBURY
State:	CT
Zip Code:	06811
Country Code:	001
Phone:	(845) 765-8507
EMail:	PERMIT@SNKPETRO.COM
Fax Number:	Not reported
Modified By:	DJLASALL
Date Last Modified:	2025-02-03

Site Id:	44246
Affiliation Type:	Facility Owner
Company Name:	1127 SOUTH SALINA SYRACUSE LLC
Contact Type:	PRESIDENT
Contact Name:	SYED KIRMANI
Address1:	26 MILL PLAIN RD
Address2:	Not reported
City:	DANBURY
State:	CT
Zip Code:	06811
Country Code:	001
Phone:	(845) 765-8507
EMail:	PERMIT@SNKPETRO.COM
Fax Number:	Not reported
Modified By:	DJLASALL
Date Last Modified:	2025-02-03

Tank Info:

Tank Number:	001
Tank ID:	126775
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	8000
Install Date:	05/01/1985
Date Tank Closed:	06/14/2007
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline

Tightness Test Method:	00
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	DJLASALL
Last Modified:	12/23/2024

Equipment Records:

C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None

1127 SOUTH SALINA SYRACUSE LLC (Continued) **U003313095**

L07 - Piping Leak Detection - Pressurized Piping Leak Detector
B02 - Tank External Protection - Original Sacrificial Anode
D11 - Pipe Type - Flexible Piping
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
H05 - Tank Leak Detection - In-Tank System (ATG)
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I02 - Overfill - High Level Alarm
I03 - Overfill - Automatic Shut-Off
K01 - Spill Prevention - Catch Basin
L08 - Piping Leak Detection - Tank Top Sump

Tank Number:	002
Tank ID:	126776
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	0
Install Date:	05/01/1985
Date Tank Closed:	06/14/2007
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	00
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	DJLASALL
Last Modified:	12/23/2024

Equipment Records:

B02 - Tank External Protection - Original Sacrificial Anode
D11 - Pipe Type - Flexible Piping
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I02 - Overfill - High Level Alarm
I03 - Overfill - Automatic Shut-Off
K01 - Spill Prevention - Catch Basin
L08 - Piping Leak Detection - Tank Top Sump
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
H05 - Tank Leak Detection - In-Tank System (ATG)

Tank Number:	003
Tank ID:	126777
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	8000

1127 SOUTH SALINA SYRACUSE LLC (Continued) **U003313095**

Install Date: 05/01/1985
Date Tank Closed: 06/14/2007
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 00
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: DJLASALL
Last Modified: 12/23/2024

Equipment Records:

C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
B02 - Tank External Protection - Original Sacrificial Anode
D11 - Pipe Type - Flexible Piping
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
H05 - Tank Leak Detection - In-Tank System (ATG)
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I02 - Overfill - High Level Alarm
I03 - Overfill - Automatic Shut-Off
K01 - Spill Prevention - Catch Basin
L08 - Piping Leak Detection - Tank Top Sump

Tank Number: 004
Tank ID: 126778
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 0
Install Date: 05/01/1985
Date Tank Closed: 06/14/2007
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 00
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: DJLASALL
Last Modified: 12/23/2024

Equipment Records:

C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
B02 - Tank External Protection - Original Sacrificial Anode

1127 SOUTH SALINA SYRACUSE LLC (Continued) **U003313095**

D11 - Pipe Type - Flexible Piping
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
H05 - Tank Leak Detection - In-Tank System (ATG)
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I02 - Overfill - High Level Alarm
I03 - Overfill - Automatic Shut-Off
K01 - Spill Prevention - Catch Basin
L08 - Piping Leak Detection - Tank Top Sump

Tank Number: 005
Tank ID: 126779
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 500
Install Date: 05/01/1985
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0022
Common Name of Substance: Waste Oil/Used Oil

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: DJLASALL
Last Modified: 12/23/2024

Equipment Records:

B07 - Tank External Protection - Retrofitted Sacrificial Anode
D00 - Pipe Type - No Piping
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
H04 - Tank Leak Detection - Groundwater Well
A00 - Tank Internal Protection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Tank Number: 006
Tank ID: 221423
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 6000
Install Date: 06/21/2007
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: 0
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

1127 SOUTH SALINA SYRACUSE LLC (Continued) **U003313095**

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: DJLASALL
Last Modified: 12/23/2024

Equipment Records:

B09 - Tank External Protection - Urethane
C02 - Pipe Location - Underground/On-ground
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off
K01 - Spill Prevention - Catch Basin
D11 - Pipe Type - Flexible Piping
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
J01 - Dispenser - Pressurized Dispenser

Tank Number: 007
Tank ID: 221424
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 6000
Install Date: 06/21/2007
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: 0
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: DJLASALL
Last Modified: 12/23/2024

Equipment Records:

B09 - Tank External Protection - Urethane
C02 - Pipe Location - Underground/On-ground
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off
K01 - Spill Prevention - Catch Basin
D11 - Pipe Type - Flexible Piping
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
J01 - Dispenser - Pressurized Dispenser

1127 SOUTH SALINA SYRACUSE LLC (Continued) **U003313095**

Tank Number:	008
Tank ID:	221425
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	4000
Install Date:	06/21/2007
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	0
Material Code:	2712
Common Name of Substance:	Gasoline/Ethanol
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	DJLASALL
Last Modified:	12/23/2024

Equipment Records:

B09 - Tank External Protection - Urethane
C02 - Pipe Location - Underground/On-ground
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off
K01 - Spill Prevention - Catch Basin
D11 - Pipe Type - Flexible Piping
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
J01 - Dispenser - Pressurized Dispenser

SPILLS:

Name:	MONDOS SERVICE CENTER
Address:	1127 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0412947 / 2005-03-14
Facility ID:	0412947
Facility Type:	ER
DER Facility ID:	273915
Site ID:	338576
DEC Region:	7
Spill Cause:	Human Error
Spill Class:	C5
SWIS:	3400
Spill Date:	2005-03-11
Investigator:	MENASH
Referred To:	Not reported
Reported to Dept:	2005-03-11
CID:	444
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported

1127 SOUTH SALINA SYRACUSE LLC (Continued) **U003313095**

Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2005-03-11
Spill Record Last Update:	2005-03-14
Spiller Name:	MARK
Spiller Company:	MONDOS SERVICE CENTER
Spiller Address:	1127 SOUTH SALINA STREET
Spiller Company:	001
Contact Name:	MARK
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	A PINT SPILLED WHEN HE WAS CLEANING AND HE ACCIDENTALLY KICKE DTHE BUCKET ALL CLEANED UP

All Materials:

Site ID:	338576
Operable Unit ID:	1100512
Operable Unit:	01
Material ID:	580805
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	GAS STATION
Address:	1127 SOUTH SALINA ST
City,State,Zip:	SYRACUSE, NY 13202
Spill Number/Closed Date:	1808400 / 2018-11-08
Facility ID:	1808400
Facility Type:	ER
DER Facility ID:	43615
Site ID:	579205
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	3415
Spill Date:	2018-11-07
Investigator:	CFNORRIS
Referred To:	Not reported
Reported to Dept:	2018-11-07
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False

1127 SOUTH SALINA SYRACUSE LLC (Continued) **U003313095**

UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2018-11-07
Spill Record Last Update:	2019-05-28
Spiller Name:	Not reported
Spiller Company:	MONDO'S
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	PATRICK VROOMAN
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	The stp sump for tank 7 failed visual inspection for a torn boot on sump product line entry boo. Dispenser # 3 and 4 failed visual inspection due to there is no secondary boot on product line.
Remarks:	stp sump failure

All Materials:

Site ID:	579205
Operable Unit ID:	1326930
Operable Unit:	01
Material ID:	2335764
Material Code:	9999
Material Name:	other - stp sump failure
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Site ID:	579205
Operable Unit ID:	1326930
Operable Unit:	01
Material ID:	2345963
Material Code:	2712
Material Name:	gasoline/ethanol
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

---

102 SYRACUSE UNIV **NY LTANKS S105997874**
ESE 900 IRVING AVE **NY Spills N/A**
1/4-1/2 SYRACUSE, NY
0.323 mi.
1705 ft.

Relative: Higher

Actual: 497 ft.

LTANKS:

Name:	SYRACUSE CARRIER DOME
Address:	900 IRVING AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0210237 / 2003-10-31

SYRACUSE UNIV (Continued) **S105997874**

Facility ID:	0210237
Site ID:	96874
Spill Date:	2003-01-10
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2003-01-10
CID:	281
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2003-01-10
Spill Record Last Update:	2003-10-31
Spiller Name:	CATHY STRICKLAND
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	SAME
Spiller County:	001
Spiller Contact:	CATHY STRICKLAND
Spiller Phone:	(607) 756-4253
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	243755
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	TANK TEST FAILURE AT ABOVE LOCATION. REPLACE MANWAY LID AND RESTEST.

All TTF:

Facility ID:	0210237
Spill Number:	0210237
Spill Tank Test:	1527928
Site ID:	96874
Tank Number:	Not reported
Tank Size:	0
Material:	Not reported
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

Facility ID:	0210237
Spill Number:	0210237
Spill Tank Test:	1527929
Site ID:	96874

SYRACUSE UNIV (Continued) **S105997874**

Tank Number:	UNK
Tank Size:	3000
Material:	Not reported
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	F
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	96874
Operable Unit ID:	861489
Operable Unit:	01
Material ID:	513627
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

SPILLS:

Name:	SYRACUSE UNIV
Address:	900 IRVING AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0300735 / 2003-04-22
Facility ID:	0300735
Facility Type:	ER
DER Facility ID:	243755
Site ID:	301633
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2003-04-21
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2003-04-21
CID:	207
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False

SYRACUSE UNIV (Continued) **S105997874**

Remediation Phase:	0
Date Entered In Computer:	2003-04-21
Spill Record Last Update:	2003-04-22
Spiller Name:	HEATHER BADGER
Spiller Company:	SYRACUSE UNIV AMBULANCE
Spiller Address:	900 IRVING AVE
Spiller Company:	001
Contact Name:	JIM MCCUMBER
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	cleanup complete

All Materials:

Site ID:	301633
Operable Unit ID:	868899
Operable Unit:	01
Material ID:	508807
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	9.00
Units:	G
Recovered:	9.00
Resource Affected:	Sewer
Oxygenate:	Not reported

X103 **MONDO'S SERVICE STATION** **NY LTANKS** **S108639805**
SW **1133 SOUTH SALINA** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.324 mi.
1713 ft. **Site 3 of 6 in cluster X**

Relative:
Lower

Actual:
390 ft.

LTANKS:

Name:	MONDO'S SERVICE STATION
Address:	1133 SOUTH SALINA
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0703031 / 2007-10-04
Facility ID:	0703031
Site ID:	382878
Spill Date:	2007-06-13
Spill Cause:	Tank Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	D3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	RJBRAZEL
Referred To:	Not reported
Reported to Dept:	2007-06-13
CID:	444
Water Affected:	SHEEN
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True

MONDO'S SERVICE STATION (Continued) **S108639805**

Remediation Phase:	0
Date Entered In Computer:	2007-06-13
Spill Record Last Update:	2007-10-04
Spiller Name:	JOHN LAVALLEY
Spiller Company:	MONDO'S SERVICE STATION
Spiller Address:	1133 SOUTH SALINA
Spiller County:	999
Spiller Contact:	JOHN LAVALLEY
Spiller Phone:	(315) 573-2577
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	332326
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	FOUND SHEEN AND ODOR WHILE REMOVING TANKS:

All Materials:

Site ID:	382878
Operable Unit ID:	1140258
Operable Unit:	01
Material ID:	2130319
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

X104 **MONDO'S SERVICE STATION** **UST FINDER RELEASE** **1029074539**
SW **1133 SOUTH SALINA** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.324 mi.
1713 ft. **Site 4 of 6 in cluster X**

Relative: **Lower**

Actual: **390 ft.**

UST FINDER RELEASE:

Object ID:	249465
Facility ID:	NY332326
Lust ID:	NY703031
Name:	MONDO'S SERVICE STATION
Address:	1133 SOUTH SALINA
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	2007/06/13 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1519
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported

MONDO'S SERVICE STATION (Continued) **1029074539**

Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.14946
Y Coord:	43.0360200000001
Latitude:	43.03602
Longitude:	-76.14946

Y105 **743 IRVING AVE.** **NY LTANKS** **S100130939**
ENE **743 IRVING AVE** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.325 mi.
1716 ft. **Site 1 of 2 in cluster Y**

Relative:
Higher

Actual:
498 ft.

LTANKS:

Name:	743 IRVING AVE.
Address:	743 IRVING AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9101558 / 1991-05-08
Facility ID:	9101558
Site ID:	180766
Spill Date:	1991-05-08
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	1991-05-08
SWIS:	3415
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1991-05-08
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	CROUSE IRVING HOSPITAL
Spiller Address:	743 IRVING AVE.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported

743 IRVING AVE. (Continued) **S100130939**

DEC Region:	7
DER Facility ID:	151618
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 05/08/91: CONTENTS OF TANK LEAKED AS TANK WAS BEING REMOVED FROM TANK PIT.SOIL WAS EVCAVATED FROM SITE IMMEADIATELY AND STAGED FOR DISPOSAL. Not reported
Remarks:	CONTAMINATED SOIL DISCOVERED DURING TANK REMOVAL.

All Materials:

Site ID:	180766
Operable Unit ID:	952671
Operable Unit:	01
Material ID:	427664
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	8.00
Resource Affected:	Soil
Oxygenate:	Not reported

Y106 **743 IRVING AVE.** **UST FINDER RELEASE** **1029060626**
ENE **743 IRVING AVE** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.325 mi.
1716 ft. **Site 2 of 2 in cluster Y**

Relative: **Higher**
Actual: **498 ft.**

UST FINDER RELEASE:

Object ID:	249572
Facility ID:	NY151618
Lust ID:	NY9101558
Name:	743 IRVING AVE.
Address:	743 IRVING AVE
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1991/05/08 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	2412
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported

743 IRVING AVE. (Continued) **1029060626**

EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1378
Y Coord:	43.0408800000001
Latitude:	43.04088
Longitude:	-76.1377999999999

107
NW
1/4-1/2
0.326 mi.
1723 ft.

HARRISON CONVENTION CTR
HARRISON & MONTGOMERY
SYRACUSE, NY 0

UST FINDER RELEASE **1029058859**
N/A

Relative:
Lower

Actual:
394 ft.

UST FINDER RELEASE:

Object ID:	249469
Facility ID:	NY129785
Lust ID:	NY9010462
Name:	HARRISON CONVENTION CTR
Address:	HARRISON & MONTGOMERY
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1990/12/28 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1746
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.14884
Y Coord:	43.04427
Latitude:	43.0442699999999
Longitude:	-76.14884

108
East
1/4-1/2
0.339 mi.
1790 ft.

SYRACUSE UNIVERISTY
OFF SKYTOP RD
SYRACUSE, NY

NY LTANKS **S106719258**
N/A

Relative:
Higher

Actual:
519 ft.

LTANKS:

Name:	SYRACUSE UNIVERISTY
Address:	OFF SKYTOP RD
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0311616 / 2004-05-04
Facility ID:	0311616
Site ID:	207927
Spill Date:	2004-01-14
Spill Cause:	Tank Failure
Spill Source:	Unknown
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2004-01-14
CID:	402
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2004-01-14
Spill Record Last Update:	2004-05-05
Spiller Name:	JIM MCOMBER
Spiller Company:	SYRACUSE UNIVERISTY
Spiller Address:	OFF SKYTOP RD
Spiller County:	001
Spiller Contact:	JIM MCOMBER
Spiller Phone:	(315) 443-4132
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	172539
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	the univ. has in grown transformers and the caller is stateing that his engineers think that they are leeking.

All Materials:

Site ID:	207927
Operable Unit ID:	876978
Operable Unit:	01
Material ID:	500410
Material Code:	0021
Material Name:	transmission fluid
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Soil

SYRACUSE UNIVERISTY (Continued) **S106719258**

Oxygenate:	Not reported
Site ID:	207927
Operable Unit ID:	876978
Operable Unit:	01
Material ID:	500409
Material Code:	0020A
Material Name:	transformer oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

W109 **SPILL NUMBER 8601815** **NY LTANKS** **S104619136**
NNW **600 S. STATE ST @ CIVIC CTR.** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.350 mi.
1846 ft. **Site 2 of 2 in cluster W**

Relative: LTANKS:
Lower

Actual: Name:	SPILL NUMBER 8601815
397 ft. Address:	600 S. STATE ST @ CIVIC CTR.
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8601815 / 1988-01-15
Facility ID:	8601815
Site ID:	137258
Spill Date:	1986-06-16
Spill Cause:	Tank Overfill
Spill Source:	Tank Truck
Spill Class:	Not reported
Cleanup Ceased:	1988-01-15
SWIS:	3415
Investigator:	UNASSIGNED
Referred To:	Not reported
Reported to Dept:	1986-06-16
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1986-07-09
Spill Record Last Update:	1995-01-03
Spiller Name:	Not reported
Spiller Company:	SEARS OIL
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	117430

SPILL NUMBER 8601815 (Continued) **S104619136**

Latitude: Not reported
Longitude: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was UK
Remarks: SPILLER TO CLEANUP

All Materials:
Site ID: 137258
Operable Unit ID: 899258
Operable Unit: 01
Material ID: 559760
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 50.00
Units: G
Recovered: .00
Resource Affected: Soil
Oxygenate: Not reported

Z110 **CASTLE REST NURSE HOME** **NY LTANKS** **S102677879**
South **401 E CASTLE ST** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.360 mi.
1903 ft. **Site 1 of 2 in cluster Z**

Relative:
Higher

Actual:
405 ft.

LTANKS:
Name: CASTLE REST NURSE HOME
Address: 401 E CASTLE ST
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 9011086 / 1991-01-31
Facility ID: 9011086
Site ID: 149961
Spill Date: 1991-01-18
Spill Cause: Tank Overfill
Spill Source: Commercial/Industrial
Spill Class: C3
Cleanup Ceased: 1991-01-20
SWIS: 3415
Investigator: ROMOCKI
Referred To: Not reported
Reported to Dept: 1991-01-18
CID: Not reported
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: True
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1991-01-31
Spill Record Last Update: 1991-01-31
Spiller Name: Not reported
Spiller Company: CASTLE REST NURSING HOME
Spiller Address: 401 E.CASTLE ST.
Spiller County: 001
Spiller Contact: Not reported

CASTLE REST NURSE HOME (Continued) **S102677879**

Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	127530
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 01/31/91: MOST OF THE SPILL WAS CONTAINED ON A CONCRETE PAD BENEATH THE VENT WHERE THE OVERFILL DISCHARGED SOME CONTAMINATED SOIL WAS STAGED IN DRUMS AT THE SCENE. TO BE REMOVED BY EPS.
Remarks:	CUSTOMER ORDERED TOO MUCH FUEL FOR TANK. FUEL WENT INTO DITCH ON OUT-SIDE OF BUILDING.

All Materials:

Site ID:	149961
Operable Unit ID:	948098
Operable Unit:	01
Material ID:	431177
Material Code:	0002A
Material Name:	#4 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	2.00
Resource Affected:	Soil
Oxygenate:	Not reported

Z111 **CASTLE REST NURSE HOME** **UST FINDER RELEASE** **1029058680**
South **401 E CASTLE ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.360 mi.
1903 ft. **Site 2 of 2 in cluster Z**

Relative:
Higher

Actual:
405 ft.

UST FINDER RELEASE:

Object ID:	249524
Facility ID:	NY127530
Lust ID:	NY9011086
Name:	CASTLE REST NURSE HOME
Address:	401 E CASTLE ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1991/01/18 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	2016
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported

CASTLE REST NURSE HOME (Continued) **1029058680**

WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1439999999999
Y Coord:	43.03432
Latitude:	43.03432
Longitude:	-76.144

X112 **1202-04 SOUTH SALINA STREET** **US BROWNFIELDS** **1027025399**
SW **1202-04 SOUTH SALINA STREET** **FINDS** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.362 mi.
1910 ft. **Site 5 of 6 in cluster X**

Relative: **Lower**

Actual: **390 ft.**

US BROWNFIELDS:

Name:	1202-04 South Salina Street
Address:	1202-04 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249199
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-21-06.0
Parcel Size:	0.09
Latitude:	43.035199564
Longitude:	-76.149780199
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	2020-09-11 00:00:00
Ownership Entity:	Private

1202-04 SOUTH SALINA STREET (Continued) **1027025399**

Additional Institutional Controls Information:	Not reported
Completion Date:	2022-09-02 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported

1202-04 SOUTH SALINA STREET (Continued) **1027025399**

Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.09
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2476
Below Poverty Percent:	49.48
Meidan Income:	2749
Meidan Income Number:	3710
Meidan Income Percent:	74.14
Vacant Housing Number:	333
Vacant Housing Percent:	16.56
Unemployed Number:	328
Unemployed Percent:	6.55

Name:	1202-04 South Salina Street
Address:	1202-04 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249199
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-21-06.0
Parcel Size:	0.09
Latitude:	43.035199564
Longitude:	-76.149780199
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported

1202-04 SOUTH SALINA STREET (Continued) **1027025399**

Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported

1202-04 SOUTH SALINA STREET (Continued) **1027025399**

RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.09
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2476
Below Poverty Percent:	49.48
Meidan Income:	2749
Meidan Income Number:	3710
Meidan Income Percent:	74.14
Vacant Housing Number:	333
Vacant Housing Percent:	16.56
Unemployed Number:	328
Unemployed Percent:	6.55

Name:	1202-04 South Salina Street
Address:	1202-04 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249199
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-21-06.0
Parcel Size:	0.09
Latitude:	43.035199564
Longitude:	-76.149780199
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported

1202-04 SOUTH SALINA STREET (Continued) **1027025399**

Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported

1202-04 SOUTH SALINA STREET (Continued) **1027025399**

RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.09
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2476
Below Poverty Percent:	49.48
Meidan Income:	2749
Meidan Income Number:	3710
Meidan Income Percent:	74.14
Vacant Housing Number:	333
Vacant Housing Percent:	16.56
Unemployed Number:	328
Unemployed Percent:	6.55

FINDS:
Registry ID: 110071090247

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as

1202-04 SOUTH SALINA STREET (Continued) **1027025399**

well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

X113 **1146 S SALINA STREET** **US BROWNFIELDS** **1027025398**
SW **1146 S SALINA STREET** **FINDS** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.366 mi.
1931 ft. **Site 6 of 6 in cluster X**

Relative: **Lower**
Actual: **390 ft.**

US BROWNFIELDS:

Name:	1146 S Salina Street
Address:	1146 S Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249198
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-21-05.0
Parcel Size:	0.16
Latitude:	43.035297968
Longitude:	-76.149961667
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	U
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported

1146 S SALINA STREET (Continued) **1027025398**

Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported

1146 S SALINA STREET (Continued) **1027025398**

Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2442
Below Poverty Percent:	50.02
Meidan Income:	2749
Meidan Income Number:	3666
Meidan Income Percent:	75.09
Vacant Housing Number:	330
Vacant Housing Percent:	16.73
Unemployed Number:	325
Unemployed Percent:	6.66

Name:	1146 S Salina Street
Address:	1146 S Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249198
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-21-05.0
Parcel Size:	0.16
Latitude:	43.035297968
Longitude:	-76.149961667
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	2020-09-11 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported

1146 S SALINA STREET (Continued) **1027025398**

Completion Date:	2022-09-02 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	U
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported

1146 S SALINA STREET (Continued) **1027025398**

RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2442
Below Poverty Percent:	50.02
Meidan Income:	2749
Meidan Income Number:	3666
Meidan Income Percent:	75.09
Vacant Housing Number:	330
Vacant Housing Percent:	16.73
Unemployed Number:	325
Unemployed Percent:	6.66

Name:	1146 S Salina Street
Address:	1146 S Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	249198
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-21-05.0
Parcel Size:	0.16
Latitude:	43.035297968
Longitude:	-76.149961667
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported

1146 S SALINA STREET (Continued) **1027025398**

Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	U
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported

1146 S SALINA STREET (Continued) **1027025398**

RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2442
Below Poverty Percent:	50.02
Meidan Income:	2749
Meidan Income Number:	3666
Meidan Income Percent:	75.09
Vacant Housing Number:	330
Vacant Housing Percent:	16.73
Unemployed Number:	325
Unemployed Percent:	6.66

FINDS:
Registry ID: 110071090246

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

114
NNE
1/4-1/2
0.372 mi.
1964 ft.

HUTCHING PSYCH CTR TANK 007
620 MADISON ST
SYRACUSE, NY 13210

NY LTANKS
NY Spills

S108956928
N/A

Relative:
Lower

Actual:
401 ft.

LTANKS:

Name:	HUTCHINGS PSYCH CENTER
Address:	620 MADISON ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0211660 / 2004-11-26
Facility ID:	0211660
Site ID:	187125
Spill Date:	2003-02-24
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	2004-11-15
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2003-02-24
CID:	396
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	2004-10-04
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2003-02-24
Spill Record Last Update:	2005-01-03
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller County:	999
Spiller Contact:	TRACIE SHIFFLET
Spiller Phone:	(315) 473-4908
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	156365
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	gross failure. believe that the leak is in the upper part of the tank and that there is no product leak.

All TTF:

Facility ID:	0211660
Spill Number:	0211660
Spill Tank Test:	1528042
Site ID:	187125
Tank Number:	10
Tank Size:	10000
Material:	0001
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03

HUTCHING PSYCH CTR TANK 007 (Continued) **S108956928**

Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	187125
Operable Unit ID:	862725
Operable Unit:	01
Material ID:	511448
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	False

SPILLS:

Name:	HUTCHING PSYC-BUILDING 10
Address:	620 MADISON AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0709106 / 2008-02-06
Facility ID:	0709106
Facility Type:	ER
DER Facility ID:	339717
Site ID:	390129
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2007-11-20
Investigator:	hdwarner
Referred To:	Not reported
Reported to Dept:	2007-11-21
CID:	408
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	2007-11-20
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2007-11-21
Spill Record Last Update:	2008-05-27
Spiller Name:	MIKE HOLIDAY
Spiller Company:	HUTCHING PSYC-BUILDING 10
Spiller Address:	620 MADISON AVE
Spiller Company:	001
Contact Name:	ANDREW AMELO

HUTCHING PSYCH CTR TANK 007 (Continued) **S108956928**

Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	HAS SPOKEN TO HARRY WARRNER FROM REGION 7 HAD STOPPED BY AND SEEN THE EXCAVATION AND DEEMED IT VISUALLY CLEAN; OIL SEPERATOR IS THE TYPE OF TANK;' THE SEAL AROUND THE TOP OF THE CONCRETE TANK APPEARS TO HAVE FAILED;

All TTF:

Facility ID:	0709106
Spill Number:	0709106
Spill Tank Test:	2365808
Site ID:	390129
Tank Number:	Not reported
Tank Size:	750
Material:	0066
EPA UST:	Not reported
UST:	True
Cause:	03
Source:	01
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Watchdog
Last Modified Date:	Not reported

All Materials:

Site ID:	390129
Operable Unit ID:	1147242
Operable Unit:	01
Material ID:	2137643
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	HUTCHINGS PC
Address:	620 MADISON ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0908714 / 2009-11-04
Facility ID:	0908714
Facility Type:	ER
DER Facility ID:	156365
Site ID:	421364
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2009-09-29
Investigator:	hdwarner

HUTCHING PSYCH CTR TANK 007 (Continued) **S108956928**

Referred To:	Not reported
Reported to Dept:	2009-11-03
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-11-03
Spill Record Last Update:	2009-11-04
Spiller Name:	Not reported
Spiller Company:	HUTCHINGS PC
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	RICH HOWARD
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	4000gal ust removed/Atlantic Testing was on site for tank pull and soil testing.Soil test show soil contamination. Harry Warner has been advised

All Materials:

Site ID:	421364
Operable Unit ID:	1177255
Operable Unit:	01
Material ID:	2170023
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

Site ID:	421364
Operable Unit ID:	1177255
Operable Unit:	01
Material ID:	2170019
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	HUTCHINGS PSYCH CENTER
Address:	620 MADISON ST

HUTCHING PSYCH CTR TANK 007 (Continued) **S108956928**

City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0208287 / 2002-11-12
Facility ID:	0208287
Facility Type:	ER
DER Facility ID:	156365
Site ID:	187124
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2002-11-11
Investigator:	CXROSSI
Referred To:	Not reported
Reported to Dept:	2002-11-11
CID:	281
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2002-11-11
Spill Record Last Update:	2002-11-12
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	RICK HOWARD
Latitude:	43.0453880
Longitude:	-76.1412335
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CTR SUMP DISCHARGE CONNECTS TO SANITARY SEWER ACCORDING TO RICK HOWARD
Remarks:	HYDRAULIC FAILURE AT ABOVE LOCATION ON ELEVATOR. MATERIAL MAY HAVE DRAINED INTO PUMP PIT WHICH FLOWS INTO STORM SEWER AT ABOVE LOCATION. REPAIR COMPANY ON SCENE. CALLER REQUESTS CALLBACK AND CAN BE REACHED ON CELL # 315-243-5852.

All Materials:

Site ID:	187124
Operable Unit ID:	859770
Operable Unit:	01
Material ID:	515296
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	5.00
Resource Affected:	Sewer
Oxygenate:	Not reported

Name:	BUILDING 12

HUTCHING PSYCH CTR TANK 007 (Continued) **S108956928**

Address:	620 MADISON ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9814456 / 2002-08-06
Facility ID:	9814456
Facility Type:	ER
DER Facility ID:	156365
Site ID:	187126
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	1999-02-27
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1999-03-03
CID:	382
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1999-03-03
Spill Record Last Update:	2002-08-06
Spiller Name:	TOM ZIENTEK
Spiller Company:	HUTCHINGS PSYCHIATRIC
Spiller Address:	620 MADISON ST
Spiller Company:	001
Contact Name:	TOM ZIENTEK
Latitude:	43.0453880
Longitude:	-76.1412335
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM SPOKE WITH TOM ZIENTEK: RECOVERED 40 GAL, WIPED DOWN SUMP PIT, DIPOSED OF OIL BY MEANS OF COLLECTION TANK THAT IS PUMPED AND DISPOSED BY CONTRACTORS ON A PERIODIC BASIS.
Remarks:	A BROKEN FUEL LINE TO A BOILER CAUSED THE SPILL. SPILL WAS ON BASEMENT FLOORING AND WAS CLEANED UP.

All Materials:

Site ID:	187126
Operable Unit ID:	1072037
Operable Unit:	01
Material ID:	311144
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	40.00
Units:	G
Recovered:	40.00
Resource Affected:	Soil
Oxygenate:	Not reported

HUTCHING PSYCH CTR TANK 007 (Continued) **S108956928**

Name:	HUTCHINGS
Address:	620 MADISON ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9312426 / 1994-01-22
Facility ID:	9312426
Facility Type:	ER
DER Facility ID:	156365
Site ID:	297513
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	1994-01-22
Investigator:	GREGG
Referred To:	Not reported
Reported to Dept:	1994-01-22
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	1994-01-22
Cleanup Meets Std:	True
Last Inspection:	1994-01-22
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	GRIFFITH OIL
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was TG
Remarks:	AIR POCKET DEVELOPED WHILE FILLING TANK. EPS HIRED TO CLEAN UP.

All Materials:

Site ID:	297513
Operable Unit ID:	994439
Operable Unit:	01
Material ID:	387855
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	HUTCHINGS PSYCH CENTER
Address:	620 MADISON STREET
City,State,Zip:	SYRACUSE, NY 13210
Spill Number/Closed Date:	0807781 / 2008-12-02

HUTCHING PSYCH CTR TANK 007 (Continued) **S108956928**

Facility ID:	0807781
Facility Type:	ER
DER Facility ID:	354391
Site ID:	405145
DEC Region:	7
Spill Cause:	Other
Spill Class:	C4
SWIS:	3415
Spill Date:	2008-10-09
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2008-10-09
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Non Major Facility > 1,100 gal
Spill Notifier:	Local Agency
Cleanup Ceased:	2008-12-02
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2008-10-09
Spill Record Last Update:	2017-06-12
Spiller Name:	Not reported
Spiller Company:	HUTCHINGS PSYCH CENTER
Spiller Address:	20 MADISON STREET
Spiller Company:	999
Contact Name:	TRACI SHIFFLET BUILDING #1
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Closed as NFA not meeting stds due to SVOC contamination that could not be remediated. See report in eDox. 6/12/2017 - Additional soil removal report received and filed. KCKemp
Remarks:	Not reported

All Materials:

Site ID:	405145
Operable Unit ID:	1161780
Operable Unit:	01
Material ID:	2152983
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	HUTCHINGS PSYCH CENTER
Address:	620 MADISON ST
City,State,Zip:	SYRACUSE, NY 13210
Spill Number/Closed Date:	0807277 / 2008-11-13
Facility ID:	0807277

HUTCHING PSYCH CTR TANK 007 (Continued) **S108956928**

Facility Type:	ER
DER Facility ID:	353576
Site ID:	404617
DEC Region:	7
Spill Cause:	Other
Spill Class:	C4
SWIS:	3415
Spill Date:	2008-09-29
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2008-09-29
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Non Major Facility > 1,100 gal
Spill Notifier:	Other
Cleanup Ceased:	2008-11-13
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2008-09-29
Spill Record Last Update:	2008-11-13
Spiller Name:	TRACIE SHIFFLET
Spiller Company:	HUTCHINGS
Spiller Address:	620 MADISON ST
Spiller Company:	999
Contact Name:	TRACIE SHIFFLET
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Minor SVOC exceedences from tank removal per eDoc'd results.KCKemp
Remarks:	Soil test results came back showing oil contamination. No clean up is scheduled.

All Materials:

Site ID:	404617
Operable Unit ID:	1161264
Operable Unit:	01
Material ID:	2152459
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	HUTCHING PSYCH CTR TANK 007
Address:	620 MADISON ST
City,State,Zip:	SYRACUSE, NY 13210
Spill Number/Closed Date:	0807003 / 2008-11-13
Facility ID:	0807003
Facility Type:	ER
DER Facility ID:	353576
Site ID:	404315

HUTCHING PSYCH CTR TANK 007 (Continued) **S108956928**

DEC Region:	7
Spill Cause:	Other
Spill Class:	C4
SWIS:	3415
Spill Date:	2008-09-22
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2008-09-22
CID:	Not reported
Water Affected:	NONE
Spill Source:	Non Major Facility > 1,100 gal
Spill Notifier:	Other
Cleanup Ceased:	2008-11-13
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2008-09-22
Spill Record Last Update:	2008-11-13
Spiller Name:	RICK HOWARD
Spiller Company:	NYS OFFICE OF MENTAL HEALTH
Spiller Address:	44 HOLLAND AVE
Spiller Company:	001
Contact Name:	RICK HOWARD
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Analytical results indicate soil contamination - tight site, no addl excavation required. Closed NFA not meeting stds. Spoils to stay on site and used as fill.
Remarks:	Analytical results indicate soil contamination

All Materials:

Site ID:	404315
Operable Unit ID:	1160980
Operable Unit:	01
Material ID:	2152169
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

115
SW
1/4-1/2
0.376 mi.
1984 ft.

1208-18 SOUTH SALINA STREET
1208-18 SOUTH SALINA STREET
SYRACUSE, NY 13202

US BROWNFIELDS **1027025381**
FINDS **N/A**

Relative:
Lower

Actual:
391 ft.

US BROWNFIELDS:

Name:	1208-18 South Salina Street
Address:	1208-18 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

Property ID:	245001
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-21-07.0
Parcel Size:	0.33
Latitude:	43.034993998
Longitude:	-76.149833005
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	2020-09-11 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2022-09-02 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.33
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2513
Below Poverty Percent:	49.47
Meidan Income:	2155
Meidan Income Number:	3762

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

Meidan Income Percent:	74.06
Vacant Housing Number:	341
Vacant Housing Percent:	16.74
Unemployed Number:	330
Unemployed Percent:	6.5
Name:	1208-18 South Salina Street
Address:	1208-18 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	245001
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-21-07.0
Parcel Size:	0.33
Latitude:	43.034993998
Longitude:	-76.149833005
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.33
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2513
Below Poverty Percent:	49.47
Meidan Income:	2155
Meidan Income Number:	3762
Meidan Income Percent:	74.06
Vacant Housing Number:	341
Vacant Housing Percent:	16.74
Unemployed Number:	330
Unemployed Percent:	6.5

Name:	1208-18 South Salina Street
Address:	1208-18 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	245001
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-21-07.0
Parcel Size:	0.33
Latitude:	43.034993998
Longitude:	-76.149833005
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.33
NFA Letter Date Received:	Not reported

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2513
Below Poverty Percent:	49.47
Meidan Income:	2155
Meidan Income Number:	3762
Meidan Income Percent:	74.06
Vacant Housing Number:	341
Vacant Housing Percent:	16.74
Unemployed Number:	330
Unemployed Percent:	6.5

Name:	1208-18 South Salina Street
Address:	1208-18 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	245001
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-21-07.0
Parcel Size:	0.33
Latitude:	43.034993998
Longitude:	-76.149833005
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase I Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

Cooperative Agreement Number:	96255719
Start Date:	2020-09-17 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2021-01-08 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.33
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2513
Below Poverty Percent:	49.47
Meidan Income:	2155
Meidan Income Number:	3762
Meidan Income Percent:	74.06
Vacant Housing Number:	341
Vacant Housing Percent:	16.74
Unemployed Number:	330
Unemployed Percent:	6.5

Name:	1208-18 South Salina Street
Address:	1208-18 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	245001
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-21-07.0
Parcel Size:	0.33
Latitude:	43.034993998
Longitude:	-76.149833005
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.33
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2513
Below Poverty Percent:	49.47
Meidan Income:	2155
Meidan Income Number:	3762
Meidan Income Percent:	74.06
Vacant Housing Number:	341
Vacant Housing Percent:	16.74
Unemployed Number:	330
Unemployed Percent:	6.5

Name:	1208-18 South Salina Street
Address:	1208-18 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	245001
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-21-07.0
Parcel Size:	0.33
Latitude:	43.034993998
Longitude:	-76.149833005
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase I Environmental Assessment

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	2020-09-17 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2021-01-08 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.33
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2513
Below Poverty Percent:	49.47
Meidan Income:	2155
Meidan Income Number:	3762
Meidan Income Percent:	74.06
Vacant Housing Number:	341
Vacant Housing Percent:	16.74
Unemployed Number:	330
Unemployed Percent:	6.5

Name:	1208-18 South Salina Street
Address:	1208-18 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	245001
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

Grant Type:	Hazardous
Property Number:	094.-21-07.0
Parcel Size:	0.33
Latitude:	43.034993998
Longitude:	-76.149833005
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.33
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2513
Below Poverty Percent:	49.47
Meidan Income:	2155
Meidan Income Number:	3762
Meidan Income Percent:	74.06
Vacant Housing Number:	341
Vacant Housing Percent:	16.74

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

Unemployed Number:	330
Unemployed Percent:	6.5
Name:	1208-18 South Salina Street
Address:	1208-18 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	245001
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	094.-21-07.0
Parcel Size:	0.33
Latitude:	43.034993998
Longitude:	-76.149833005
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	PAHs Petroleum Products VOCs
Contaminants Found at Actionable Level:	PAHs Petroleum Products VOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	2020-09-11 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2022-09-02 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.33
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported

1208-18 SOUTH SALINA STREET (Continued) **1027025381**

Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2513
Below Poverty Percent:	49.47
Meidan Income:	2155
Meidan Income Number:	3762
Meidan Income Percent:	74.06
Vacant Housing Number:	341
Vacant Housing Percent:	16.74
Unemployed Number:	330
Unemployed Percent:	6.5

FINDS:
Registry ID: 110071090229

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

---

116 West 1/4-1/2 0.380 mi. 2006 ft. **S&F AUTOMOTIVE**
420 ONEIDA ST
SYRACUSE, NY

NY LTANKS **S100494064**
N/A

Relative: Lower

Actual: 390 ft.

LTANKS:

Name:	S&F AUTOMOTIVE
Address:	420 ONEIDA ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9207347 / 1992-10-05
Facility ID:	9207347
Site ID:	194355
Spill Date:	1992-09-24
Spill Cause:	Tank Failure
Spill Source:	Commercial Vehicle
Spill Class:	D5
Cleanup Ceased:	1992-10-05
SWIS:	3415
Investigator:	MENASH
Referred To:	Not reported
Reported to Dept:	1992-09-24
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Affected Persons
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1992-09-25
Spill Record Last Update:	1992-10-05

S&F AUTOMOTIVE (Continued) **S100494064**

Spiller Name:	Not reported
Spiller Company:	S & F AUTOMOTIVE
Spiller Address:	420 ONEIDA ST
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	161962
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MN 10/05/92: NO RESPONSE MADE.
Remarks:	VEHICLE LEAKED ONTO PAVEMENT AND OIL SWEEPED INTO STORM SEWER BY S&F PERSONNEL.

All Materials:

Site ID:	194355
Operable Unit ID:	974302
Operable Unit:	01
Material ID:	407985
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	50.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

AA117 **HARRISON PARKING GARAGE** **NY LTANKS** **S105054356**
NW **WARREN & HARRISON ST** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.390 mi.
2059 ft. **Site 1 of 2 in cluster AA**

Relative:
Lower

Actual:
392 ft.

LTANKS:

Name:	HARRISON PARKING GARAGE
Address:	WARREN & HARRISON ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9010749 / 1999-11-26
Facility ID:	9010749
Site ID:	121632
Spill Date:	1991-01-05
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	VOLLMER
Referred To:	Not reported
Reported to Dept:	1991-01-08
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported

HARRISON PARKING GARAGE (Continued) **S105054356**

Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1991-01-13
Spill Record Last Update:	1999-11-26
Spiller Name:	Not reported
Spiller Company:	HARRISON PARK GARAGE CORP
Spiller Address:	SUITE 702 - MONY TOWER 2
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	105583
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was DV 04/10/91: OPTIONS FOR ON SITE REMEDIATION OF SOIL UNDER STUDY. 02/28/92: PAASIVE SOIL VENT TO BE INCLUDED IN FINAL CONSTRUCTION PHASE.
Remarks:	CONTAMINATED SOIL DISCOVERED WHEN EXCAVATING FOR NEW PARKING GARAGE.

All Materials:

Site ID:	121632
Operable Unit ID:	947890
Operable Unit:	01
Material ID:	562056
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

AA118 **HARRISON PARKING GARAGE** **UST FINDER RELEASE** **1029056971**
NW **WARREN & HARRISON ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.390 mi.
2059 ft. **Site 2 of 2 in cluster AA**

Relative:
Lower

Actual:
392 ft.

UST FINDER RELEASE:

Object ID:	249457
Facility ID:	NY105583
Lust ID:	NY9010749
Name:	HARRISON PARKING GARAGE
Address:	WARREN & HARRISON ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1991/01/05 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1512
Domestic Wells within 1500ft:	0

HARRISON PARKING GARAGE (Continued) **1029056971**

Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1508499999999
Y Coord:	43.0443000000001
Latitude:	43.0443
Longitude:	-76.15085

---

119 **JMA CAMPUS PLAN** **NY BROWNFIELDS** **S132119353**
WSW **623 ONEIDA STREET** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.393 mi.
2077 ft.

Relative: **Lower**

Actual: **390 ft.**

BROWNFIELDS:

Name:	JMA CAMPUS PLAN
Address:	623 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	667687
Acres:	6.960
HW Code:	C734166
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	05/15/2024
Record Updated Date:	06/11/2024
Update By:	GWPRISCO
Site Description:	"Location: The JMA Campus Plan (Site) is a 6.96-acre property located in an urban area at 623 Oneida Street, in the City of Syracuse, Onondaga County, New York. The Site limits are bounded by West Taylor Street to the north, the former South Clinton Street to the east, Tallman Street to the south, and Oneida Street to the west. The Site is comprised of what was once 24 separate, contiguous parcels, that were recently re-zoned to form a single parcel. Site Features: The Site features include gravel or paved parking lots, small green space areas, and three vacant buildings. Current Zoning and Land Use: The Site is zoned industrial and consists of the following features: Gravel or paved parking lots, Limited green space areas, and Three vacant buildings; Neighboring properties include various commercial and industrial facilities in all directions, with the closest residences located approximately 0.1-miles to the west. Onondaga

JMA CAMPUS PLAN (Continued) **S132119353**

Creek, a tributary to Onondaga Lake, is located approximately 580-feet to the west of the Site. The site is depicted as Census Block 360670042002 which is classified as Enzone Type AB and is Listed as a disadvantaged community. The Site entire 6.96-acre project Site is within this boundary. Past Use of the Site: The Site has historically primarily been utilized by industrial facilities as far back as the early 1900 s with various occupants including: Syracuse Stamp, a manufacturer of high-quality garage door hardware, gate faucets and inked ribbon spools since 1908. This property is a potential source of contamination given the use of heavy machinery and metals. Underground storage tanks were also previously located on the site. Tompkins USA a manufacturer of knitting machinery and equipment for the textile industry located in Syracuse since 1914. This property is a potential source of contamination given the use of heavy machinery for textiles. Sources of heat likely also included coal burning equipment and fuel oil from bulk storage tanks. Horizon Transport, a junk yard and storage facility. This property is a potential source of contamination given the junk yard/scrap yard uses for many years, the disarray of the facility, and multiple leaking vehicles and drums observed on the property. Coyne Textile Fleet Truck Maintenance Facility. This property is a potential source of chlorinated VOC contamination given the history as a Coyne Textile property. Trucks from the Coyne fleet were often taken to this property for repair, washing, etc. Evidence of contamination was observed during the previous environmental investigations. Site Geology and Hydrogeology: According to the USDA Web Soil Survey for Onondaga County, soils beneath the Site consist of Urban Land. Review of the USGS Geologic Map of New York indicates the bedrock geology of the area consists of the Syracuse Formation of the Upper Silurian age. Generally, the bedrock consists of dolostone and shale. Regional groundwater flow direction, inferred from topographic mapping of the area and historical investigations, is generally west towards Onondaga Creek. "

Env Problem:	"Information submitted with the BCP application regarding the environmental condition at the site are currently under review and will be revised as additional information becomes available."
Health Problem:	"Information submitted with the BCP application regarding the conditions at the site are currently under review and will be revised as additional information becomes available."
Dump:	Not reported
Structure:	Not reported
Lagoon:	Not reported
Landfill:	Not reported
Pond:	Not reported
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	Not reported
Record Upd:	Not reported
Updated By:	Not reported
Own Op:	1
Sub Type:	E
Owner Name:	Dino Peios
Owner Company:	JMA Tech Properties, LLC
Owner Address:	PO Box 580
Owner Addr2:	Not reported

JMA CAMPUS PLAN (Continued) **S132119353**

Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America
Own Op:	4
Sub Type:	E
Owner Name:	Dino Peios
Owner Company:	JMA Tech Properties, LLC
Owner Address:	PO Box 580
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	C01
Owner Name:	Not reported
Owner Company:	Onondaga Public Library Central Branch
Owner Address:	447 South Salina St
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Dino Peios
Owner Company:	JMA Tech Properties, LLC
Owner Address:	PO Box 580
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America
HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	Not reported
Cross Ref Type Code:	Not reported
Cross Ref Type:	Not reported
Record Added Date:	Not reported
Record Updated:	Not reported
Updated By:	Not reported

AB120 **BYRNE DAIRY** **NY LTANKS** **S105998214**
WSW **KING ST** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.398 mi.
2102 ft. **Site 1 of 2 in cluster AB**

Relative: **Lower**

Actual: **390 ft.**

LTANKS:

Name:	BYRNE DAIRY
Address:	KING ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0211606 / 2003-07-30
Facility ID:	0211606
Site ID:	109545
Spill Date:	2003-02-22
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	D5
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported

BYRNE DAIRY (Continued) **S105998214**

Reported to Dept:	2003-02-22
CID:	396
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2003-02-22
Spill Record Last Update:	2003-07-30
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	TIM DEREAMER
Spiller Phone:	(716) 727-4523
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	96112
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	tank overflow due to having the wrong trank size info.

All Materials:

Site ID:	109545
Operable Unit ID:	862693
Operable Unit:	01
Material ID:	511393
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	5.00
Resource Affected:	Soil
Oxygenate:	Not reported

AC121 **MONTGOMERY STREET** **NY LTANKS** **S106719238**
NNW **MONGOMERY ST AND MADISON** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.400 mi.
2110 ft. **Site 1 of 2 in cluster AC**

Relative:
Lower

Actual:
395 ft.

LTANKS:

Name:	MONTGOMERY STREET
Address:	MONGOMERY ST AND MADISON
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0310457 / 2003-12-15
Facility ID:	0310457
Site ID:	316015
Spill Date:	2003-12-10
Spill Cause:	Tank Failure
Spill Source:	Unknown
Spill Class:	D4

MONTGOMERY STREET (Continued) **S106719238**

Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	2003-12-10
CID:	404
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2003-12-10
Spill Record Last Update:	2003-12-15
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	BARB WHITE
Spiller Phone:	(315) 435-8884
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	254763
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was HW
Remarks:	no response required. just need a spill number. a leak in a gas tank caused the spill.

All Materials:

Site ID:	316015
Operable Unit ID:	875549
Operable Unit:	01
Material ID:	499312
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

AB122 **BYRNE DAIRY** **NY LTANKS** **S100128532**
WSW **235 KING STREET** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.401 mi.
2117 ft. **Site 2 of 2 in cluster AB**

Relative: LTANKS:
Lower

Name:	BYRNE DAIRY
Address:	235 KING STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8603904 / 1988-01-15
Facility ID:	8603904

Actual:
390 ft.

BYRNE DAIRY (Continued) **S100128532**

Site ID:	198191
Spill Date:	1986-09-16
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Cleanup Ceased:	1988-01-15
SWIS:	3415
Investigator:	VOLLMER
Referred To:	Not reported
Reported to Dept:	1986-09-16
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1986-09-17
Spill Record Last Update:	1988-01-15
Spiller Name:	Not reported
Spiller Company:	BYRNE DAIRY
Spiller Address:	235 KING ST.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	164948
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was JR / / : CLEMETT CO. IS TANK TESTER COMPANY.
Remarks:	TANK TESTED OUT OF TOLERANCE -.657 PER HOUR

All Materials:

Site ID:	198191
Operable Unit ID:	901148
Operable Unit:	01
Material ID:	476717
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

AD123 **DISTRICT HEATING & COOLING PLANT** **NY LTANKS** **S104514136**
NNW **601 S STATE ST** **NY Spills** **N/A**
1/4-1/2 **SYRACUSE, NY 13202** **NY AIRS**
0.411 mi. **NY MANIFEST**
2168 ft. **Site 1 of 2 in cluster AD**

Relative: **Lower**
Actual: **397 ft.**

LTANKS:

Name:	STEAM STATION
Address:	601 S. STATE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8602554 / 1988-12-12
Facility ID:	8602554
Site ID:	93875
Spill Date:	1986-07-18
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1988-11-28
SWIS:	3415
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	1986-07-18
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1986-07-25
Spill Record Last Update:	1988-12-12
Spiller Name:	Not reported
Spiller Company:	ONONDAGA COUNTY STEAM STA
Spiller Address:	PAUL ELLARD
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	84107
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was HW 08/18/86: 200-300 GALLONS OF 6 FUEL ENTERED GROUNDWATER VIA TANK FALUIRE. EOI EMPTIED OLD TANK AND RECOVERED SPILLED PRODUCT.
Remarks:	ENVIRONMENTAL OIL CO. WAS CALLED BY ONONDAGA COUNTY STEAM STATION & RESPONDED. GROUNDWATER CLEANUP BEING PERFORMED.

All Materials:

Site ID:	93875
Operable Unit ID:	899836
Operable Unit:	01
Material ID:	478984
Material Code:	0003A
Material Name:	#6 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	200.00
Units:	G

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

SPILLS:

Name:	STEAM STATION-S.STATE ST.
Address:	601 S. STATE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9106022 / 1991-09-05
Facility ID:	9106022
Facility Type:	ER
DER Facility ID:	84107
Site ID:	190544
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	1986-09-04
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1991-09-04
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	1991-09-05
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	True
Remediation Phase:	0
Date Entered In Computer:	1991-09-04
Spill Record Last Update:	1991-09-05
Spiller Name:	Not reported
Spiller Company:	ONON. CO. STEAM STATION
Spiller Address:	601 S.STATE ST.
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0462538
Longitude:	-76.1474007
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 09/04/91: CONTRACTOR WILL ATTEMPT TO EXCAVATE CONTAMINATED SOIL. 09/05/91: CONTAMINATED SOIL EXCAVATED AND STAGED ON SITE. SOIL SAMPLES TO BE TAKEN FROM WALL OF EXCAVATION TO DOCUMENT CONDITIONS AFTER EXCAVATING.
Remarks:	CONTAMINATED SOIL DISCOVERED DURING TANK REMOVAL.

All Materials:

Site ID:	190544
Operable Unit ID:	960360
Operable Unit:	01
Material ID:	421774
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Material FA:	Petroleum
Quantity:	25.00
Units:	G
Recovered:	25.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	STEAM PLANT GARAGE
Address:	601 SOUTH STATE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2307378 / 2023-12-20
Facility ID:	2307378
Facility Type:	ER
DER Facility ID:	604827
Site ID:	659433
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D2
SWIS:	3442
Spill Date:	2023-12-06
Investigator:	DGMILLER
Referred To:	Not reported
Reported to Dept:	2023-12-06
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2023-12-06
Spill Record Last Update:	2023-12-20
Spiller Name:	JESSE
Spiller Company:	ONONDAGA CO
Spiller Address:	601 SOUTH STATE ST
Spiller Company:	999
Contact Name:	JESSE
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Cleaned up by rp
Remarks:	Clean up pending

All Materials:

Site ID:	659433
Operable Unit ID:	1406269
Operable Unit:	01
Material ID:	2423654
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.50
Units:	G
Recovered:	Not reported

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Resource Affected: Not reported
Oxygenate: Not reported

AIRS:
Name: DISTRICT HEATING & COOLING PLANT
Address: 601 S STATE ST
City,State,Zip: SYRACUSE, NY 13202
DECID: 7311500112
Process ID: Not reported
Latitude: Not reported
Longitude: Not reported
FIPS Code: Not reported
Auth Type Code: AFR

Permit Status: Issued
Auth Status Code: 2
Emissions: Not reported
Issue date: 06/11/2008
Expired Date: Not reported
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

Permit Status: Expired
Auth Status Code: 7
Emissions: Not reported
Issue date: 07/05/2006
Expired Date: 06/11/2008
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

Permit Status: Expired
Auth Status Code: 7
Emissions: Not reported
Issue date: 03/08/2004
Expired Date: 07/05/2006
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

NY MANIFEST:
EPA ID: NY0000033688
Country: USA
Name: Syracuse City Of Public Service Building
Address: 601 SOUTH STATE ST
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Location Address 1:	601 SOUTH STATE ST
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Syracuse City Of Public Service Building
Mailing Contact:	Roger Widay
Mailing Address 1:	511 S STATE ST
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3154358367

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	05/26/2009
Trans1 Recv Date:	05/26/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/12/2009
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD010154045
TSDF ID 2:	Not reported
Manifest Tracking Number:	000634225JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Lead
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	750
Units:	Pounds
Number of Containers:	2
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	05/26/2009
Trans1 Recv Date:	05/26/2009
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/12/2009
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD010154045
TSDF ID 2:	Not reported
Manifest Tracking Number:	000634225JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Lead
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1100
Units:	Pounds
Number of Containers:	3
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	VTA0064296

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Manifest Status:	Not reported
Trans1 State ID:	NYPD7793
Year:	1994
Trans2 State ID:	Not reported
Generator Ship Date:	06/14/1994
Trans1 Recv Date:	06/14/1994
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/20/1994
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	NYD012928347
Trans2 EPA ID:	Not reported
TSDF ID 1:	VTD982766537
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Lead
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00050
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00

Document ID:	MAH7549900
Manifest Status:	Not reported
Trans1 State ID:	13908MA
Year:	1995
Trans2 State ID:	4938BSOK
Generator Ship Date:	11/13/1995
Trans1 Recv Date:	11/13/1995
Trans2 Recv Date:	11/20/1995
TSD Site Recv Date:	11/20/1995
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	MAD000604447
Trans2 EPA ID:	ARD981908551
TSDF ID 1:	MAD000604447
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Potassium Cyanide (Or) Potassium Cyanide K(Cn)
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00

Document ID:	PAC8097202
Manifest Status:	Not reported
Trans1 State ID:	PAAH0147
Year:	1993
Trans2 State ID:	Not reported
Generator Ship Date:	12/02/1993
Trans1 Recv Date:	12/02/1993
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	12/03/1993
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	NYD051809952
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Lead
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Waste Code 6:	Not reported
Quantity:	00055
Units:	Gallons (liquids only)
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	06/25/2010
Trans1 Recv Date:	06/25/2010
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/12/2010
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	002472766FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H132
Waste Code a:	B007
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	160
Units:	Kilograms
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Trans1 State ID:	NYR000115733
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	02/24/2011
Trans1 Recv Date:	02/24/2011
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/28/2011
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD085690592
TSDF ID 2:	Not reported
Manifest Tracking Number:	003548146FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H071
Waste Code a:	Chromium
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1536
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Cargo tanks (tank trucks)
Handling Method:	Treat
Specific Gravity:	1

Document ID:	NYB7540893
Manifest Status:	Not reported
Trans1 State ID:	13908MA
Year:	1995
Trans2 State ID:	98115FNY
Generator Ship Date:	11/13/1995
Trans1 Recv Date:	11/13/1995
Trans2 Recv Date:	11/14/1995
TSD Site Recv Date:	11/14/1995
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Trans1 EPA ID:	NYD982792814
Trans2 EPA ID:	NYD982792814
TSDF ID 1:	NYD000632372
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Corrosive Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Waste Code 7:	Reactive Waste
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Treat
Specific Gravity:	01.00
Waste Code 12:	Ignitable Waste
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYB7540902
Manifest Status:	Not reported
Trans1 State ID:	13908MA
Year:	1995
Trans2 State ID:	5245BFOK
Generator Ship Date:	11/13/1995

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Trans1 Recv Date:	11/13/1995
Trans2 Recv Date:	11/15/1995
TSD Site Recv Date:	11/16/1995
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	MAD000604447
Trans2 EPA ID:	ARD981908551
TSDF ID 1:	NCD000648451
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Benzene, 1,1'-(2,2,2-Trichloroethylidene)Bis[4-Chloro- (Or) Ddt
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 7:	2,4-Dinitrophenol (Or) Phenol, 2,4-Dinitro-
Waste Code 8:	Not reported
Waste Code:	Not reported
Waste Code 10:	Not reported
Waste Code 11:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 12:	Ignitable Waste
Waste Code 13:	Not reported
Waste Code 14:	Not reported
Waste Code 15:	Not reported
Waste Code 16:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00
Waste Code 17:	Reactive Waste

DISTRICT HEATING & COOLING PLANT (Continued) **S104514136**

Waste Code 18:	Not reported
Waste Code 19:	Not reported
Waste Code 20:	Not reported
Waste Code 21:	Not reported
Quantity:	00020
Units:	Pounds
Number of Containers:	001
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYB6726231
Manifest Status:	Not reported
Trans1 State ID:	R39387ME
Year:	1995
Trans2 State ID:	Not reported
Generator Ship Date:	02/28/1995
Trans1 Recv Date:	02/28/1995
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	03/04/1995
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000033688
Trans1 EPA ID:	CTD982191942
Trans2 EPA ID:	Not reported
TSDF ID 1:	OHD980700942
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Lead
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00050
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

AD124 **STEAM STATION-S.STATE ST.** **UST FINDER RELEASE** **1029078785**
NNW **601 S. STATE ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.411 mi.
2168 ft. **Site 2 of 2 in cluster AD**

Relative:
Lower

Actual:
397 ft.

UST FINDER RELEASE:

Object ID:	249477
Facility ID:	NY84107
Lust ID:	NY9106022
Name:	STEAM STATION-S.STATE ST.
Address:	601 S. STATE ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1986/09/04 16:00:00+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1605
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1473999999999
Y Coord:	43.04625
Latitude:	43.04625
Longitude:	-76.1474

---

125 **BYRNE DAIRY INC.** **NY LTANKS** **U003313193**
West **240 ONEIDA STREET** **NY UST** **N/A**
1/4-1/2 **SYRACUSE, NY 13202** **NY CBS**
0.413 mi. **NY AST**
2183 ft. **NY Spills**
NY SPDES

Relative:
Lower

Actual:
390 ft.

LTANKS:

Name:	BYRNE DAIRY
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9804457 / 2000-11-08
Facility ID:	9804457
Site ID:	64142
Spill Date:	1998-07-09
Spill Cause:	Tank Overfill

BYRNE DAIRY INC. (Continued) **U003313193**

Spill Source:	Commercial/Industrial
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	1998-07-09
CID:	204
Water Affected:	Not reported
Spill Notifier:	Local Agency
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1998-07-09
Spill Record Last Update:	2000-11-08
Spiller Name:	JOHN MCNANARA
Spiller Company:	BYRNE DAIRY
Spiller Address:	240 ONIEDA STREET
Spiller County:	001
Spiller Contact:	JOHN HERMAN
Spiller Phone:	(315) 697-8437
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	142067
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was HW
Remarks:	CONTAMINATION FOUND IN SPILL AREA

Name:	BYRNE DAIRY
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9703387 / 1997-06-30
Facility ID:	9703387
Site ID:	109079
Spill Date:	1997-06-11
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	D4
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1997-06-11
CID:	999
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1997-06-18
Spill Record Last Update:	1997-06-18
Spiller Name:	RON STODDARD

BYRNE DAIRY INC. (Continued) **U003313193**

Spiller Company:	BYRNE DAIRY
Spiller Address:	240 ONEIDA ST
Spiller County:	001
Spiller Contact:	RON STODDARD
Spiller Phone:	(315) 475-2111
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	142067
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	DURING EXCAVATION FOR ADDITION TO FACTORY UNCOVERED LIMITED AMOUNT OF CONTAMINAED SOIL FROM TANK REMOVAL - OLD SPILL NO. 87-8332 .O5 YRD
Name:	BYRNE DAIRY
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8708332 / 1988-02-04
Facility ID:	8708332
Site ID:	168673
Spill Date:	1987-12-28
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Cleanup Ceased:	1988-02-04
SWIS:	3415
Investigator:	AJMARSCH
Referred To:	Not reported
Reported to Dept:	1987-12-28
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1988-01-05
Spill Record Last Update:	1988-02-08
Spiller Name:	Not reported
Spiller Company:	BYRNE DAIRY
Spiller Address:	NEIL MCLAIN
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	142067
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was JM / / : TANKS WERE ABANDONED AND FILLED IN PLACE ON 01/07/88. NO CONTAMINATION FOUND. TANKS WERE MANIFOLDED TOGETHER.
Remarks:	TWO 3,000 GAL. TANKS MANIFOLDED TOGETHER. FAILURE RATE UNKNOWN.

All Materials:

Site ID:	168673
Operable Unit ID:	912967

BYRNE DAIRY INC. (Continued) **U003313193**

Operable Unit: 01
Material ID: 463723
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: Not reported
Recovered: .00
Resource Affected: Groundwater
Oxygenate: Not reported

UST:
Name: BYRNE DAIRY INC.
Address: 240 ONEIDA STREET
City,State,Zip: SYRACUSE, NY 13202
Id/Status: 7-162175 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 7
Expiration Date: N/A
UTM X: 405992.32117
UTM Y: 4766113.61803
Site Type: Manufacturing (Other than Chemical)/Processing

Affiliation Records:
Site Id: 44909
Affiliation Type: Facility Owner
Company Name: BYRNE DAIRY INC.
Contact Type: Not reported
Contact Name: Not reported
Address1: 240 ONEIDA ST.
Address2: Not reported
City: SYRACUSE
State: NY
Zip Code: 13202
Country Code: 001
Phone: (315) 475-2111
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 44909
Affiliation Type: Mail Contact
Company Name: BYRNE DAIRY INC.
Contact Type: Not reported
Contact Name: JOHN MCNAMARA
Address1: 240 ONEIDA ST.
Address2: Not reported
City: SYRACUSE
State: NY
Zip Code: 13202
Country Code: 001
Phone: (315) 475-2111
EMail: Not reported

BYRNE DAIRY INC. (Continued) **U003313193**

Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 44909
Affiliation Type: Facility Operator
Company Name: BYRNE DAIRY INC.
Contact Type: Not reported
Contact Name: BYRNE DAIRY INC.
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (315) 475-2111
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 44909
Affiliation Type: Emergency Contact
Company Name: BYRNE DAIRY INC.
Contact Type: Not reported
Contact Name: JOHN MCNAMARA
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (315) 475-2121
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 001
Tank ID: 129206
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 4000
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported

BYRNE DAIRY INC. (Continued) **U003313193**

Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 002
Tank ID: 129207
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 10000
Install Date: 05/01/1974
Date Tank Closed: 07/01/1998
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0008
Common Name of Substance: Diesel

Tightness Test Method: 03
Date Test: 11/01/1996
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 003
Tank ID: 129208
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 3000
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001

BYRNE DAIRY INC. (Continued) **U003313193**

Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 004
Tank ID: 129209
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 3000
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MJGRIFFI
Last Modified: 05/09/2022

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

CBS:
Name: BYRNE DAIRY
Address: 240 ONEIDA STREET
City,State,Zip: SYRACUSE, NY 13202
CBS Number: 7-000339
Program Type: CBS

BYRNE DAIRY INC. (Continued) **U003313193**

Facility Status: Unregulated/Closed
Expiration Date: Not reported
Dec Region: 7
UTMX: 406024.08117
UTMY: 4766063.70714

Name: UPSTATE FARMS DAIRY, LLC
Address: 240 ONEIDA ST
City,State,Zip: SYRACUSE, NY 13202
CBS Number: 7-000299
Program Type: CBS
Facility Status: Active
Expiration Date: 11/29/2025
Dec Region: 7
UTMX: 405992.32117
UTMY: 4766113.61803

AST:
Name: BYRNE DAIRY
Address: 240 ONEIDA STREET
City,State,Zip: SYRACUSE, NY 13202
Region: STATE
DEC Region: 7
Site Status: Unregulated/Closed
Facility Id: 7-000339
Program Type: CBS
UTM X: 406024.08117
UTM Y: 4766063.70714
Expiration Date: N/A
Site Type: Manufacturing (Other than Chemical)/Processing

Tank Info:

Tank Number: 54-1050-1
Tank Id: 195202
Tank Location: Aboveground - contact with impervious barrier... Tank bottom rests on impervious barrier, allowing visual indication of leaks.
Tank Type: Plastic
Tank Status: Administratively Closed
Pipe Model: Not reported
Install Date: 11/01/2003
Capacity Gallons: 685
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 12/02/2015
Register: True
Modified By: MJGRIFFI
Last Modified: 05/09/2022
Material Name: Not reported

SPILLS:
Name: BYRNE DAIRY
Address: 240 ONEIDA ST
City,State,Zip: SYRACUSE, NY 13202
Spill Number/Closed Date: 1308782 / 2014-01-07
Facility ID: 1308782

BYRNE DAIRY INC. (Continued) **U003313193**

Facility Type:	ER
DER Facility ID:	360242
Site ID:	489538
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2013-12-02
Investigator:	KCKEMP
Referred To:	Not reported
Reported to Dept:	2013-12-02
CID:	Not reported
Water Affected:	NONE
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	2014-01-07
Cleanup Meets Std:	True
Last Inspection:	2013-12-02
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2013-12-02
Spill Record Last Update:	2014-01-07
Spiller Name:	TOM CORP
Spiller Company:	BYRNE DAIRY
Spiller Address:	240 ONEIDA ST
Spiller Company:	999
Contact Name:	TOM CORP
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	12/02/2013 - Dock leveller being tested burst hydraulic hose, spilling approx 3 gallons non-PCB hydraulic oil to concrete and pavement. Spill booms and absorbent used to prevent spilled oil from reaching sotrm drainage system. EP&S contracted to clean area after hydraulics were repaired. BECI Donk advised. KCKemp 1/7/2014 - Disposal receipt and bill of lading rec4eived and filed. Spill closed. BECI Donk advised. KCKemp
Remarks:	Loss to pavement, c/u pending

All Materials:

Site ID:	489538
Operable Unit ID:	1239116
Operable Unit:	01
Material ID:	2239085
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3.00
Units:	G
Recovered:	3.00
Resource Affected:	Impervious Surface
Oxygenate:	Not reported

Name: 240 ONEIDA ST

BYRNE DAIRY INC. (Continued) **U003313193**

Address:	240 ONEIDA ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1008505 / 2010-11-15
Facility ID:	1008505
Facility Type:	ER
DER Facility ID:	397022
Site ID:	441997
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2010-11-14
Investigator:	cxrossi
Referred To:	Not reported
Reported to Dept:	2010-11-14
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	2010-11-14
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2010-11-14
Spill Record Last Update:	2010-11-15
Spiller Name:	CHRISTIAN BRUNELLE
Spiller Company:	BYRNE DAIRY
Spiller Address:	240 ONEIDA ST
Spiller Company:	999
Contact Name:	PAUL SPENCER
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Byrne Dairy garbage truck broke a hydraulic line. Fluid spread to surrounding pavement, roadway,and two catch basins. Plant workers cleaned up pavement with speedy dry and cleaned the furthermost affected catch basin with absorbent pads. Catch basin next to building which received a great amount, flows back to plant to be treated with other milk waste materials and then discharges to sanitary sewer according to CHRISTIAN BRUNELLE. ~ctr~ 11/15/10
Remarks:	Caller advised hydraulic fluid spilled onto pavement. Clean up is in process.

All Materials:

Site ID:	441997
Operable Unit ID:	1192529
Operable Unit:	01
Material ID:	2187859
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	25.00
Units:	G
Recovered:	25.00

BYRNE DAIRY INC. (Continued) **U003313193**

Resource Affected: Soil, Sewer
Oxygenate: Not reported

SPDES:

Name: Upstate Farms Dairy, Llc
Address: 240 ONEIDA ST
City,State,Zip: SYRACUSE, NY
Permit Number: NYR00G338
State-Region: 07
Expiration Date: Not reported
Current Major Minor Status: Not reported
Primary Facility SIC Code: Not reported
State Water Body Name: Not reported
Limit Set Status Flag: Not reported
Total Actual Average Flow(MGD): Not reported
Total App Design Flow(MGD): Not reported
UDF1: Not reported
Lat/Long: Not reported
DMR Cognizant Official: Not reported
UDF2: Not reported
UDF3: Not reported
FIPS County Code: Not reported

Non-Gov Permit Affiliation Type Desc: Not reported
Non-Gov Permit Org Formal Name: UPSTATE NIAGARA COOPERATIVE INC.
Non-Gov Permit Street Address: PO BOX 268
Non-Gov Permit Supplemental Location: Not reported
Non-Gov Permit City: Not reported
Non-Gov Permit State Code: Not reported
Non-Gov Permit Zip Code: Not reported
Non-Gov Facility Affiliation Type Desc: Not reported
Non-Gov Facility Org Formal Name: Not reported
Non-Gov Facility Street Address: Not reported
Non-Gov Facility Supplemental Location: Not reported
Non-Gov Facility City: Not reported
Non-Gov Facility State Code: Not reported
Non-Gov Facility Zip Code: Not reported
State Water Body: Not reported
Region Permit Processed: Not reported
Dow Discharge Class Code: Not reported
SPDES Class Description: Not reported
Affiliation Type Description: Not reported
Name: Not reported
Contacts Title: Not reported
Contacts Email: Not reported
NOI Submission Date: Not reported
Facility Type: General Permit

Name: Byrne Dairy Fluid Milk Plant
Address: 240 ONEIDA STREET
City,State,Zip: SYRACUSE, NY 13202-3373
UDF2: Not reported
UDF3: Not reported
FIPS County Code: NY067

BYRNE DAIRY INC. (Continued) **U003313193**

Non-Gov Permit Affiliation Type Desc:	Billing
Non-Gov Permit Org Formal Name:	TOM CORP
Non-Gov Permit Street Address:	ULTRA DAIRY 6700 WEST BENEDICT RD
Non-Gov Permit Supplemental Location:	Not reported
Non-Gov Permit City:	EAST SYRACUSE
Non-Gov Permit State Code:	NY
Non-Gov Permit Zip Code:	13057
Non-Gov Facility Affiliation Type Desc:	Owner
Non-Gov Facility Org Formal Name:	BYRNE DAIRY INC
Non-Gov Facility Street Address:	BYRNE DAIRY FLUID MILK PLANT
Non-Gov Facility Supplemental Location:	2394 US RTE 11
Non-Gov Facility City:	LAFAYETTE
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	13084
State Water Body:	Not reported
Region Permit Processed:	Not reported
Dow Discharge Class Code:	Not reported
SPDES Class Description:	Not reported
Affiliation Type Description:	Not reported
Name:	Not reported
Contacts Title:	Not reported
Contacts Email:	Not reported
NOI Submission Date:	Not reported
Facility Type:	Not reported

Name:	Byrne Dairy Fluid Milk Plant
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY 13202-3373
UDF2:	Not reported
UDF3:	Not reported
FIPS County Code:	NY067

Non-Gov Permit Affiliation Type Desc:	DMR Mailing Address
Non-Gov Permit Org Formal Name:	TOM CORP
Non-Gov Permit Street Address:	BYRNE DAIRY FLUID MILK PLANT
Non-Gov Permit Supplemental Location:	ULTRA DAIRY 6700 WEST BENEDICT RD
Non-Gov Permit City:	EAST SYRACUSE
Non-Gov Permit State Code:	NY
Non-Gov Permit Zip Code:	13057
Non-Gov Facility Affiliation Type Desc:	Owner
Non-Gov Facility Org Formal Name:	BYRNE DAIRY INC
Non-Gov Facility Street Address:	BYRNE DAIRY FLUID MILK PLANT
Non-Gov Facility Supplemental Location:	2394 US RTE 11
Non-Gov Facility City:	LAFAYETTE
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	13084
State Water Body:	Not reported
Region Permit Processed:	Not reported
Dow Discharge Class Code:	Not reported
SPDES Class Description:	Not reported
Affiliation Type Description:	Not reported
Name:	Not reported
Contacts Title:	Not reported
Contacts Email:	Not reported
NOI Submission Date:	Not reported
Facility Type:	Not reported

BYRNE DAIRY INC. (Continued) **U003313193**

Name:	Byrne Dairy Fluid Milk Plant
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY 13202-3373
UDF2:	Not reported
UDF3:	Not reported
FIPS County Code:	NY067
Non-Gov Permit Affiliation Type Desc:	Permittee
Non-Gov Permit Org Formal Name:	BYRNE DAIRY INC
Non-Gov Permit Street Address:	2394 US 11
Non-Gov Permit Supplemental Location:	Not reported
Non-Gov Permit City:	LAFAYETTE
Non-Gov Permit State Code:	NY
Non-Gov Permit Zip Code:	13084
Non-Gov Facility Affiliation Type Desc:	Owner
Non-Gov Facility Org Formal Name:	BYRNE DAIRY INC
Non-Gov Facility Street Address:	BYRNE DAIRY FLUID MILK PLANT
Non-Gov Facility Supplemental Location:	2394 US RTE 11
Non-Gov Facility City:	LAFAYETTE
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	13084
State Water Body:	Not reported
Region Permit Processed:	Not reported
Dow Discharge Class Code:	Not reported
SPDES Class Description:	Not reported
Affiliation Type Description:	Not reported
Name:	Not reported
Contacts Title:	Not reported
Contacts Email:	Not reported
NOI Submission Date:	Not reported
Facility Type:	Not reported
Name:	Byrne Dairy Fluid Milk Plant
Address:	240 ONEIDA STREET
City,State,Zip:	SYRACUSE, NY 13202-3373
UDF2:	Not reported
UDF3:	Not reported
FIPS County Code:	NY067
Non-Gov Permit Affiliation Type Desc:	Not reported
Non-Gov Permit Org Formal Name:	Not reported
Non-Gov Permit Street Address:	Not reported
Non-Gov Permit Supplemental Location:	Not reported
Non-Gov Permit City:	Not reported
Non-Gov Permit State Code:	Not reported
Non-Gov Permit Zip Code:	Not reported
Non-Gov Facility Affiliation Type Desc:	Owner
Non-Gov Facility Org Formal Name:	BYRNE DAIRY INC
Non-Gov Facility Street Address:	BYRNE DAIRY FLUID MILK PLANT
Non-Gov Facility Supplemental Location:	2394 US RTE 11
Non-Gov Facility City:	LAFAYETTE
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	13084
State Water Body:	Not reported
Region Permit Processed:	Not reported
Dow Discharge Class Code:	Not reported
SPDES Class Description:	Not reported

BYRNE DAIRY INC. (Continued) **U003313193**

Affiliation Type Description:	Not reported
Name:	Not reported
Contacts Title:	Not reported
Contacts Email:	Not reported
NOI Submission Date:	Not reported
Facility Type:	Not reported

AE126 **HUTCHINGS** **UST FINDER RELEASE** **1029062132**
NNE **500 CEDAR ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.416 mi.
2194 ft. **Site 1 of 2 in cluster AE**

Relative: **Lower**

Actual: **400 ft.**

UST FINDER RELEASE:

Object ID:	249543
Facility ID:	NY169331
Lust ID:	NY8710954
Name:	HUTCHINGS
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1988/03/31 16:00:00+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1623
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.14208
Y Coord:	43.04618
Latitude:	43.04618
Longitude:	-76.14208

127
NE
1/4-1/2
0.418 mi.
2206 ft.

HUTCHINGS PHSYC CENTER
625 MADISON STREET
SYRACUSE, NY

NY LTANKS
NY Spills

S104790422
N/A

Relative:
Higher

Actual:
406 ft.

LTANKS:

Name:	HUTCHINGS PHSYC CENTER
Address:	625 MADISON STREET
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0411489 / 2005-04-14
Facility ID:	0411489
Site ID:	336700
Spill Date:	2005-01-25
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	HDWARNER
Referred To:	Not reported
Reported to Dept:	2005-01-25
CID:	444
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2005-01-25
Spill Record Last Update:	2005-04-14
Spiller Name:	TRACI SHIFFLET
Spiller Company:	HUTCHINGS PHSYC CENTER
Spiller Address:	625 MADISON STREET
Spiller County:	001
Spiller Contact:	TRACI SHIFFLET
Spiller Phone:	(315) 473-4980
Spiller Extention:	4992
DEC Region:	7
DER Facility ID:	272028
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	PBS No: 7-041904

All TTF:

Facility ID:	0411489
Spill Number:	0411489
Spill Tank Test:	1548528
Site ID:	336700
Tank Number:	003
Tank Size:	10000
Material:	0001
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II

HUTCHINGS PHSYC CENTER (Continued) **S104790422**

Leak Rate: .00
Gross Fail: Not reported
Modified By: Watchdog
Last Modified Date: Not reported

All Materials:
Site ID: 336700
Operable Unit ID: 1098709
Operable Unit: 01
Material ID: 578885
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: G
Recovered: .00
Resource Affected: Groundwater
Oxygenate: Not reported

SPILLS:
Name: MEDICAL RESEARCH BLDG
Address: 625 MADISON STREET
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 0008056 / 2000-10-31
Facility ID: 0008056
Facility Type: ER
DER Facility ID: 272028
Site ID: 252960
DEC Region: 7
Spill Cause: Unknown
Spill Class: B3
SWIS: 3415
Spill Date: 2000-10-10
Investigator: CFMANNES
Referred To: Not reported
Reported to Dept: 2000-10-10
CID: 211
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: 2000-10-10
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2000-10-10
Spill Record Last Update: 2000-11-02
Spiller Name: Not reported
Spiller Company: MEDICAL RESEARCH BLDG
Spiller Address: 625 MADISON ST
Spiller Company: 001
Contact Name: Not reported
Latitude: Not reported

HUTCHINGS PHSYC CENTER (Continued) **S104790422**

Longitude: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks: PRODUCT SPILLED INTO SINK AND IS NOW CRYSTALIZING - REQ DEC REP TO SCENE - FIRE DEPT ON SCENE

All Materials:
Site ID: 252960
Operable Unit ID: 830514
Operable Unit: 01
Material ID: 566100
Material Code: 0036B
Material Name: carbolic acid
Case No.: 00108952
Material FA: Hazardous Material
Quantity: .00
Units: G
Recovered: .00
Resource Affected: Soil
Oxygenate: Not reported

AE128 **HUTCHINGS PSYCHIATRIC CTR** **NY LTANKS** **S103558239**
NNE **BLDG 11** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.420 mi.
2218 ft. **Site 2 of 2 in cluster AE**

Relative:
Lower

Actual:
400 ft.

LTANKS:
Name: HUTCHINGS PSYCHIATRIC CTR
Address: BLDG 11
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 9809684 / 2003-10-31
Facility ID: 9809684
Site ID: 121287
Spill Date: 1998-11-02
Spill Cause: Tank Overfill
Spill Source: Commercial/Industrial
Spill Class: C3
Cleanup Ceased: Not reported
SWIS: 3415
Investigator: CFMANNES
Referred To: Not reported
Reported to Dept: 1998-11-02
CID: 365
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1998-11-02
Spill Record Last Update: 2003-11-20
Spiller Name: Not reported
Spiller Company: HUTCHINGS PSYCHIATRIC CTR
Spiller Address: BLDG 11
Spiller County: 001
Spiller Contact: OGS - MIKE HOLIDAY

HUTCHINGS PSYCHIATRIC CTR (Continued) **S103558239**

Spiller Phone:	(315) 430-8513
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	105279
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	POSS OVERFILLED CAUSED SPILL THAT WAS NOTICED DURING AN UNDERGROUND TANK REMOVAL - THEY WILL EXCAVATE CONTAMINATED SOIL, INVESTIGATE & TAKE SAMPLES

AF129 **500 SOUTH SALINA STREET** **UST FINDER RELEASE** **1029058890**
WNW **500 SOUTH SALINA STREET** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.425 mi.
2246 ft. **Site 1 of 4 in cluster AF**

Relative: **Lower**
Actual: **391 ft.**

UST FINDER RELEASE:

Object ID:	249451
Facility ID:	NY130242
Lust ID:	NY9960057
Name:	500 SOUTH SALINA STREET
Address:	500 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	2000/02/21 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1161
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.15216
Y Coord:	43.0440400000001
Latitude:	43.04404
Longitude:	-76.1521599999999

AF130 **CHIMES BUILDING** **NY BROWNFIELDS** **S132119340**
WNW **500-550 SOUTH SALINA STREET** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.425 mi.
2246 ft. **Site 2 of 4 in cluster AF**

Relative:
Lower

Actual:
391 ft.

BROWNFIELDS:

Name:	CHIMES BUILDING
Address:	500-550 SOUTH SALINA STREET
City,State,Zip:	SYRACUSE, NY 13202
Program:	BCP
Site Code:	662655
Acres:	1.255
HW Code:	C734165
SWIS:	3415
Town:	Syracuse (c)
Record Added Date:	01/24/2024
Record Updated Date:	08/02/2024
Update By:	IABEILBY
Site Description:	"Location: The site is located in the central portion of the City of Syracuse commercial district. The 1.255-acre site is surrounded by South Salina Street to the east, West Onondaga Street to the north, South Clinton Street to the west, and an office building to the south. Neighboring development is primarily commercial in nature. The surrounding properties include a parking garage and the Syracuse Transit Hub / CENTRO Bus Station located to the east, across South Salina Street; the Marriott Downton Syracuse hotel to the northeast, across South Salina Street; the Salt City Market to the north, across West Onondaga Street; a rail line that runs north to south to the west, across South Clinton Street; and the United States Department of Veterans Affairs building and parking lot to the south. There are currently no surface water bodies on or adjacent to the subject property. The closest surface water body is Onondaga Creek, located approximately 200 feet west of the site. Onondaga Creek Flows through the area in a general northerly direction and empties into the southern end of Onondaga Lake approximately 2.04 miles north of the site. Onondaga Creek originates in the Tully Lakes watershed and generally flows in a northerly direction through the Tully and Onondaga Valleys. Site Features: The subject property is currently developed with a 12-story steel frame and masonry building that is used for mixed commercial and residential use. The building was constructed in 1927 with an addition added to the southern corner of the building in 1970. The building fronts on South Salina Street and West Onondaga Street. The exterior portions of the property consist of asphalt paved parking lot to the west and south of the building. The parking lot is accessed via South Salina Street to the east and is surrounded by a wrought iron or steel fence. The site is located at 399 feet above mean sea level (amsl) on the eastern portion and slopes to a surface elevation of about 393 feet amsl along the lower western portion. Current Zoning and Land Use: The site is currently zoned for Central Business District (MX-5) under the City of Syracuse s City Zoning Ordinance (March 2023). The site s current land use is office building per Onondaga County GIS. The building that occupies the Site is partially occupied by a mix of residential and commercial tenants at this time. The commercial tenants and their operations are as follows: (1) Level 3 Communications, LLC (also known as CenturyLink), occupies space on the second floor for use as a fiber cable hub facility (head end). Their space consists of fiber, electronics, and building mechanicals to regulate room temperature

CHIMES BUILDING (Continued) **S132119340**

and power equipment. The space does not actively occupy employees, only equipment service employees, as needed. (2) Charter Communications (also known as Spectrum), occupies two spaces in the basement of the building for use as a fiber cable hub facility (head end). Their space consists of fiber, electronics, and building mechanicals to regulate room temperature and power equipment. The space does not actively occupy employees, only equipment service employees, as needed. (3) Northland Communications occupies space on the second and the elevator penthouse for use as a fiber cable hub facility (head end). Their space consists of fiber, electronics, and building mechanicals to regulate room temperature and power equipment. The space does not actively occupy employees, only equipment service employees, as needed. (4) Casa Mia Food LLC operates a retail grocery store/pizzeria on the first floor of the building and utilizes the building for a retail store and food prep area, and backroom merchandise storage area with coolers. The store is actively occupied by employees daily and is open to the public. (5) Metro by T Mobile operates a retail wireless store on the first floor of the building, fronting South Salina Street. Their operation consists of a retail area for cellular telephones and accessories, and a small back room for storage of merchandise. The store is actively occupied by employees daily and is open to the public. (6) Dish Wireless occupies space on the rooftop of the building and their space consists of fiber cable and antennas for use in transmitting cellular wireless signals. The space does not actively occupy employees, only equipment service employees, as needed. The properties surrounding the Site are zoned for a combination of Central Business District (MX-5) and Light Industry and Employment (LI). The properties surrounding the Site have a combination of land uses including office buildings, motor vehicle service, parking garage, public transportation, hotel, row buildings, railroad, and vacant commercial uses. Past Use of the Site: The subject property and surrounding area have a long history of commercial and residential use. Prior to the existing structure, the site was occupied by multiple dwellings on the western portion, stores on the eastern and northeastern portion, and a Women Christian Association home on the southeastern portion. In the early 1900s, some of the dwellings on the northwestern corner of the site had been replaced with stores and a furniture repair shop. The existing Chimes Building was reportedly constructed between 1927 and 1929. By the mid-1900s (c. 1950s), the Chimes Building contained a bank, offices, and store fronts, and the remainder of the property had been redeveloped with a restaurant building located adjacent to the Chimes Building on the north section of the site, another commercial building containing a store and restaurant on the northwest portion of the site, and a filling station with two gasoline tanks on the southeastern portion of the site. A dry-cleaning facility was also present on the southeastern portion of the subject property in the 1960s. Site Geology and Hydrogeology: The site is located within the Erie-Ontario Lowlands physiographic province of New York. The surficial geology at and ion the vicinity of the site is mapped as lacustrine silt and clay on the Surficial Geology Map of New York, Finger Lakes Sheet, dated 1986. Lacustrine silt and clay is a generally laminated formation of clay and silt that was deposited in proglacial lakes. These soils are generally calcareous, and variable in thickness, up to 50 meters. The soil lithology observed across the site during past environmental investigations generally consists of an upper layer of

CHIMES BUILDING (Continued) **S132119340**

	historical fill material (HFM), which was comprised of a heterogenous mix of gravel, brick fragments, ash, coal fragments, cinders, and slag. The depth of the HFM ranged in depths from approximately 0.5 feet to 13 feet below ground surface (bgs). This fill material was generally underlain by natural deposits comprised of a mixture of clay/silt, fine to medium sand, and fine to medium gravel and cobble. The bedrock beneath and in the vicinity of the site is mapped as dolostone, shale, gypsum, and salt of the Syracuse Formation on the Geologic Map of New York, Finger Lakes Sheet, dated 1970. Bedrock has not been investigated during previous environmental investigations. The groundwater table ranged from 22 feet to 28 feet bgs across the site. Based on the overserved topography of the site and the surrounding area, it is believed the groundwater on the site and within the vicinity of the site likely flows west toward Onondaga Creek. "
Env Problem:	"Information submitted with the BCP application regarding the environmental condition at the site are currently under review and will be revised as additional information becomes available."
Health Problem:	"Information submitted with the BCP application regarding the conditions at the site are currently under review and will be revised as additional information becomes available."
Dump:	Not reported
Structure:	Not reported
Lagoon:	Not reported
Landfill:	Not reported
Pond:	Not reported
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	Not reported
Record Upd:	Not reported
Updated By:	Not reported
Own Op:	4
Sub Type:	E
Owner Name:	Maarten Jacobs
Owner Company:	Chimes Syracuse LLC
Owner Address:	484 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Maarten Jacobs
Owner Company:	Chimes Syracuse LLC
Owner Address:	484 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	E
Owner Name:	Maarten Jacobs
Owner Company:	Chimes Syracuse LLC
Owner Address:	484 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America

CHIMES BUILDING (Continued) **S132119340**

Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Dan Smith
Owner Company:	Onondaga County Public Library Central Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13205
Owner Country:	United States of America
HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	2307739
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2024-03-13 09:31:00
Record Updated:	2024-03-13 09:31:00
Updated By:	AYRUSSO

AF131 **THE CHIMES BUILDING** **US BROWNFIELDS** **1031288681**
WNW **500-550 SOUTH SALINA STREET** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.425 mi.
2246 ft. **Site 3 of 4 in cluster AF**

Relative: **Lower**
Actual: **391 ft.**

US BROWNFIELDS:

Name:	The Chimes Building
Address:	500-550 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	258433
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Not reported
Property Number:	096.-5-01.0
Parcel Size:	1.3
Latitude:	43.043830117
Longitude:	-76.152480429
Census Tract:	36067003200
State or Tribal Voluntary Response Program:	Y
Program Name:	4B
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Lead Other Metals SVOCs
Contaminants Found at Actionable Level:	Lead Other Metals SVOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported

THE CHIMES BUILDING (Continued) **1031288681**

Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96219123
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported

THE CHIMES BUILDING (Continued) **1031288681**

Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	1.3
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2410
Below Poverty Percent:	48.97
Meidan Income:	3135
Meidan Income Number:	3382
Meidan Income Percent:	68.73
Vacant Housing Number:	704
Vacant Housing Percent:	23.8
Unemployed Number:	369
Unemployed Percent:	7.5

Name:	The Chimes Building
Address:	500-550 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	258433
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Not reported
Property Number:	096.-5-01.0
Parcel Size:	1.3
Latitude:	43.043830117
Longitude:	-76.152480429
Census Tract:	36067003200
State or Tribal Voluntary Response Program:	Y
Program Name:	4B
AA Activity Funded:	Phase I Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported

THE CHIMES BUILDING (Continued) **1031288681**

Redevelopment Funding:	Not reported
Contaminants REC:	Lead Other Metals SVOCs
Contaminants Found at Actionable Level:	Lead Other Metals SVOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96219123
Start Date:	2023-11-20 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2024-01-10 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported

THE CHIMES BUILDING (Continued) **1031288681**

Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	1.3
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2410
Below Poverty Percent:	48.97
Meidan Income:	3135
Meidan Income Number:	3382
Meidan Income Percent:	68.73
Vacant Housing Number:	704
Vacant Housing Percent:	23.8
Unemployed Number:	369
Unemployed Percent:	7.5

Name:	The Chimes Building
Address:	500-550 South Salina Street
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	258433
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Not reported
Property Number:	096.-5-01.0
Parcel Size:	1.3
Latitude:	43.043830117
Longitude:	-76.152480429
Census Tract:	36067003200
State or Tribal Voluntary Response Program:	Y
Program Name:	4B

THE CHIMES BUILDING (Continued) **1031288681**

AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Lead Other Metals SVOCs
Contaminants Found at Actionable Level:	Lead Other Metals SVOCs
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96219123
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported

THE CHIMES BUILDING (Continued) **1031288681**

RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	1.3
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2410
Below Poverty Percent:	48.97
Meidan Income:	3135
Meidan Income Number:	3382
Meidan Income Percent:	68.73
Vacant Housing Number:	704
Vacant Housing Percent:	23.8
Unemployed Number:	369
Unemployed Percent:	7.5

AG132
SW
1/4-1/2
0.427 mi.
2256 ft.

CNY CENTRO INC
200 CORTLAND AVE
SYRACUSE, NY 13205

Site 1 of 2 in cluster AG

NY LTANKS **S103570665**
NY CBS **N/A**
NY Spills
NY AIRS

Relative:
Lower

Actual:
390 ft.

LTANKS:

Name:	CNY CENTRO INC.
Address:	200 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9413883 / 2002-08-06
Facility ID:	9413883
Site ID:	230780
Spill Date:	1995-01-18
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1995-01-18
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1995-02-08
Spill Record Last Update:	2002-08-06
Spiller Name:	Not reported
Spiller Company:	CNY CENTRO INC.
Spiller Address:	200 CORTLAND AVENUE
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	190176
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM NO REPORT SUBMITTED
Remarks:	TANK TEST FAILURE.

All Materials:

Site ID:	230780
Operable Unit ID:	1011411
Operable Unit:	01
Material ID:	372631
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Soil

CNY CENTRO INC (Continued) **S103570665**

Oxygenate: Not reported

Name: CNY CENTRO, INC.
Address: 200 CORTLAND AVENUE
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 9508450 / 1995-10-11
Facility ID: 9508450
Site ID: 230781
Spill Date: 1995-10-11
Spill Cause: Tank Overfill
Spill Source: Commercial/Industrial
Spill Class: D5
Cleanup Ceased: 1995-12-31
SWIS: 3415
Investigator: CFMANNES
Referred To: Not reported
Reported to Dept: 1995-10-11
CID: 266
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1995-10-11
Spill Record Last Update: 1996-01-02
Spiller Name: DAVID RYAN
Spiller Company: CNY CENTRO, INC.
Spiller Address: 200 CORTLAND AVENUE
Spiller County: 001
Spiller Contact: DAVID RYAN
Spiller Phone: (315) 442-3325
Spiller Extention: Not reported
DEC Region: 7
DER Facility ID: 190176
Latitude: Not reported
Longitude: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks: OVERFLOW FROM VENT DURING FILLING. ONTO SOIL. HOWARD FROM SYRACUSE OFFICE NOTIFIED. SOIL TO BE CLEANED UP.

All Materials:
Site ID: 230781
Operable Unit ID: 1022909
Operable Unit: 01
Material ID: 362970
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Resource Affected: Soil
Oxygenate: Not reported

CNY CENTRO INC (Continued) **S103570665**

Site ID:	230781
Operable Unit ID:	1022909
Operable Unit:	01
Material ID:	362971
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	5.00
Resource Affected:	Soil
Oxygenate:	Not reported

CBS:

Name:	CNY CENTRO INC.
Address:	200 CORTLAND AVE.
City,State,Zip:	SYRACUSE, NY 13205
CBS Number:	7-000172
Program Type:	CBS
Facility Status:	Active
Expiration Date:	08/11/2026
Dec Region:	7
UTMX:	406071.56450
UTMY:	4765375.47900

SPILLS:

Name:	SYRACUSE CENTRO BUS
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0911732 / 2010-06-25
Facility ID:	0911732
Facility Type:	ER
DER Facility ID:	363839
Site ID:	424569
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	3415
Spill Date:	2010-02-03
Investigator:	MJROMOCK
Referred To:	Not reported
Reported to Dept:	2010-02-03
CID:	Not reported
Water Affected:	N/A
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2010-02-03
Spill Record Last Update:	2011-03-28

CNY CENTRO INC (Continued) **S103570665**

Spiller Name:	STEVE PROSONIC
Spiller Company:	SYRACUSE CENTRO BUS
Spiller Address:	200 CORTLAND AVE
Spiller Company:	999
Contact Name:	STEVE PROSONIC
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	3/3/10 - Called CENTRO bus garage. Vehicle Lift in garage is leaking. The lift has been taken out of service. Repairs and cleanup to be effected in near future. CENTRO to call NYSDEC when work will be done. 03/25/2010 - Inspected site. Met with Dave Ryan of CENTRO Bus. leaking hydrualic system has been removed. Underground pipe has been excavted and soil samples collected from spill area after cleanup. Photos were taken. Closure report to be submitted by CENTRO. 6/22/10 - Rec'd closure documents. Closing file. 3/28/11 - Call from CENTRO garage. Excavation of this spill site underway. Exvation report to be submitted to NYSDEC.
Remarks:	DUE TO A BROKEN HYDRAULIC FLUID LINE ABOUT 12 GALLONS SPILLED TO SOIL. CLEAN UP PENDING.

All Materials:

Site ID:	424569
Operable Unit ID:	1180334
Operable Unit:	01
Material ID:	2174215
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	12.00
Units:	G
Recovered:	12.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	CENTRAL NY TRANSPORT AUTH
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1901686 / 2019-05-20
Facility ID:	1901686
Facility Type:	ER
DER Facility ID:	363839
Site ID:	588580
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2019-05-17
Investigator:	CXROSSI
Referred To:	Not reported
Reported to Dept:	2019-05-17
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle

CNY CENTRO INC (Continued) **S103570665**

Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	2019-05-17
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2019-05-17
Spill Record Last Update:	2019-05-20
Spiller Name:	NATHAN DOW
Spiller Company:	CENTRAL NY TRANSPORT AUTH
Spiller Address:	200 CORTLAND AVE
Spiller Company:	999
Contact Name:	NATHAN DOW
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	loss to sewer and soil- c/u pending vac truck

All Materials:

Site ID:	588580
Operable Unit ID:	1336238
Operable Unit:	01
Material ID:	2345579
Material Code:	0015
Material Name:	motor oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	10.00
Resource Affected:	Soil, Sewer
Oxygenate:	Not reported

Name:	PAVEMENT AND SOIL
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1904009 / 2019-08-01
Facility ID:	1904009
Facility Type:	ER
DER Facility ID:	363839
Site ID:	591988
DEC Region:	7
Spill Cause:	Unknown
Spill Class:	C4
SWIS:	3415
Spill Date:	2019-07-19
Investigator:	CFNORRIS
Referred To:	Not reported
Reported to Dept:	2019-07-19
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported

CNY CENTRO INC (Continued) **S103570665**

Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2019-07-19
Spill Record Last Update:	2019-08-01
Spiller Name:	NATHAN DOW
Spiller Company:	CNYRTA
Spiller Address:	200 CORTLAND AVE
Spiller Company:	999
Contact Name:	NATHAN DOW
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	HYDRAULIC OIL SPILL TO PAVEMENT. NO SOIL OR DRAINS AFFECTED. EPS TO COLLECT SPEEDI-DRI
Remarks:	clean up has started

All Materials:

Site ID:	591988
Operable Unit ID:	1339598
Operable Unit:	01
Material ID:	2349194
Material Code:	0015
Material Name:	motor oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	2.00
Units:	G
Recovered:	Not reported
Resource Affected:	Impervious Surface
Oxygenate:	Not reported

Name:	GARAGE
Address:	200 CORTLAND AVE.
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0910008 / 2010-06-25
Facility ID:	0910008
Facility Type:	ER
DER Facility ID:	371679
Site ID:	422746
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	3415
Spill Date:	2009-12-09
Investigator:	MJROMOCK
Referred To:	Not reported
Reported to Dept:	2009-12-09
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0

CNY CENTRO INC (Continued) **S103570665**

Date Entered In Computer:	2009-12-09
Spill Record Last Update:	2010-06-25
Spiller Name:	STEVE PROSONIC
Spiller Company:	CNY CENTRO
Spiller Address:	200 CORTLAND AVE.
Spiller Company:	999
Contact Name:	STEVE PROSONIC
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Lift removed from service . To be excavted and remediated in near future. 6/22/10 Rec'd closure documentation. Closing file.
Remarks:	UNDERGROUND HYDRAULIC LINE FAILURE, SPILL AMOUNT UNKNOWN AT THIS TIME, LEAKED MAINLY INTO GRAVEL UNDER BUILDING, CLEANUP PENDING FURTHER INVESTIGATION.

All Materials:

Site ID:	422746
Operable Unit ID:	1178574
Operable Unit:	01
Material ID:	2172031
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	CNY BUS GARAGE
Address:	200 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0500747 / 2005-06-02
Facility ID:	0500747
Facility Type:	ER
DER Facility ID:	190176
Site ID:	343801
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	3415
Spill Date:	2005-04-15
Investigator:	MENASH
Referred To:	Not reported
Reported to Dept:	2005-04-18
CID:	444
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0

CNY CENTRO INC (Continued) **S103570665**

Date Entered In Computer:	2005-04-18
Spill Record Last Update:	2005-06-02
Spiller Name:	RAYMOND CROSSLEY
Spiller Company:	CNY BUS GARAGE
Spiller Address:	200 CORTLAND AVE
Spiller Company:	001
Contact Name:	RAYMOND CROSSLEY
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	LINES TO LIFTS ROTTED OUT: WILL START WORKING ON TOMORROW, TO LOCATE PROBLEM:

All Materials:

Site ID:	343801
Operable Unit ID:	1102480
Operable Unit:	01
Material ID:	582699
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	72.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	CENTRAL BUS
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0902638 / 2009-06-08
Facility ID:	0902638
Facility Type:	ER
DER Facility ID:	363839
Site ID:	414692
DEC Region:	7
Spill Cause:	Other
Spill Class:	C3
SWIS:	3415
Spill Date:	2009-06-03
Investigator:	MJROMOCK
Referred To:	Not reported
Reported to Dept:	2009-06-04
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-06-04
Spill Record Last Update:	2009-06-08
Spiller Name:	STEVE PROSONIC

CNY CENTRO INC (Continued) **S103570665**

Spiller Company:	CNYRTA GARAGE
Spiller Address:	200 CORTLAND AVE
Spiller Company:	999
Contact Name:	STEVE PROSONIC
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	06/04/09 -Inspected site. Solvent spilled when a parts cleaner cabinet that had been disposed of in a dumpster tipped over. Some solvent had been inadvertenly left in the cabinet and leaked out. Spill fell to the ground and paved area near the dumpster. Some blacktop was picked up along with some contaminated soil. Environmental Products and Services is scheduled to pick up the excavated material for disposal. 06/08/09 - Excavated material picked up from Centro Garage. Material was picked up by Environmental Products and Services. Rec'd copy of Dispoal documents. Closing file.
Remarks:	CALLER STATES THAT THE PRODUCT WAS IN A DUMPSTER AND WHEN THE DUMPSTER WAS PICKED UP THE PRODUCT SPILLED TO SOIL AND PAVEMENT. CLEAN UP IS IN PROGRESS, SPILL IS CONTAINED.

All Materials:

Site ID:	414692
Operable Unit ID:	1171074
Operable Unit:	01
Material ID:	2162861
Material Code:	0014A
Material Name:	mineral/white spirits
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	8.00
Resource Affected:	Soil, Impervious Surface
Oxygenate:	Not reported

Name:	REPAIR BAYS 18 & 19
Address:	200 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0700048 / 2008-02-01
Facility ID:	0700048
Facility Type:	ER
DER Facility ID:	190176
Site ID:	379293
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D3
SWIS:	3415
Spill Date:	2007-04-02
Investigator:	kacahill
Referred To:	Not reported
Reported to Dept:	2007-04-02
CID:	408
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party

CNY CENTRO INC (Continued) **S103570665**

Cleanup Ceased:	2007-07-27
Cleanup Meets Std:	False
Last Inspection:	2007-05-17
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2007-04-02
Spill Record Last Update:	2008-02-01
Spiller Name:	DAVID RYAN
Spiller Company:	REPAIR BAYS 18 & 19
Spiller Address:	200 CORTLAND AVE
Spiller Company:	001
Contact Name:	DAVID RYAN
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Spoke to David Ryan. Source of spill is a leak in seals in hydraulic lift. Preventative maintenance conducted on 3/20 and 3/23 on this lift and seals were in tact at that time. On 3/30/07, they noticed that oil was down 40 gallons. They called in their contractor, Filtrec, and they tested the system today. They fixed the seals but the system is still leaking under the slab. They have hired C&S to retrofit all of the lifts. Onondaga Creek is about 500 feet from this facility. I indicated to Dave that he would need to collect confirmation samples and run for STARS and PCBs. He said he would call me once work is scheduled, estimated for next week. 4/12/07 Contacted Dave to get an update on the work. Since work will cost in excess of $15,000, it has to be approved by the board. The next board meeting is not until end of the month. 04/27/07 Spoke to Dave. The board approved the proposal. Work scheduled to beging week of May 7th. 05/17/07 Filtrec removed slab and pipe runs from oil pump to lift. Source of spill determined to be leak in one of the pipes. DEC inspected floor and piping. Filtrec will remove affected subgrade material, and new pump and piping will be installed. Centro plans to retrofit all lifts this year. Asked Dave Ryan for copy of the confirmation sampling analytical results and soil disposal receipts. 01/08/08 Contacted Dave Ryan to request confirmation sample results and disposal receipts so spill can be closed. 02/01/08 Received analytical results and disposal receipts. Closed spill.
Remarks:	NOT YET CLEANED; HAD SIMILAR LEAK IN JUNE OF 05’;

All Materials:

Site ID:	379293
Operable Unit ID:	1136783
Operable Unit:	01
Material ID:	2126736
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	40.00

CNY CENTRO INC (Continued) **S103570665**

Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	200 CORTLAND AVE
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1214613 / 2013-01-15
Facility ID:	1214613
Facility Type:	ER
DER Facility ID:	433182
Site ID:	477861
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2013-01-15
Investigator:	cxrossi
Referred To:	Not reported
Reported to Dept:	2013-01-15
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Passenger Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2013-01-15
Spill Record Last Update:	2013-01-15
Spiller Name:	Not reported
Spiller Company:	PERSONAL VEHICLE
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	STEVE PROSONIC
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	15 qts - speedi dri in use

All Materials:

Site ID:	477861
Operable Unit ID:	1227659
Operable Unit:	01
Material ID:	2225102
Material Code:	0021
Material Name:	transmission fluid
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3.00
Units:	G
Recovered:	3.00
Resource Affected:	Impervious Surface
Oxygenate:	Not reported

CNY CENTRO INC (Continued) **S103570665**

Name:	CENTRO
Address:	200 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0107608 / 2003-10-07
Facility ID:	0107608
Facility Type:	ER
DER Facility ID:	190176
Site ID:	299297
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2001-10-22
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2001-10-25
CID:	257
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2001-10-25
Spill Record Last Update:	2003-10-07
Spiller Name:	BOB PALLADINE
Spiller Company:	CENTRO
Spiller Address:	200 CORTLAND AVE
Spiller Company:	001
Contact Name:	BOB PALLADINE
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	leaking lift

All Materials:

Site ID:	299297
Operable Unit ID:	845718
Operable Unit:	01
Material ID:	532426
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	CENTRO GARAGE-CORTLAND AV
Address:	200 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9301095 / 1993-04-23

CNY CENTRO INC (Continued) **S103570665**

Facility ID:	9301095
Facility Type:	ER
DER Facility ID:	190176
Site ID:	299298
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D5
SWIS:	3415
Spill Date:	1993-04-22
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1993-04-22
CID:	Not reported
Water Affected:	ONON.CREEK
Spill Source:	Commercial Vehicle
Spill Notifier:	DEC
Cleanup Ceased:	1993-04-23
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	SYRACUSE LADDER AND SCFFO
Spiller Address:	621 HIAWATHA BLVD. WEST
Spiller Company:	001
Contact Name:	Not reported
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR
Remarks:	HYRAULIC LINE RUPTURED ON DELIVERY TRUCK IN CENTRO PARKING LOT. SPILL WAS NOT PROPERLY REPORTED NOR CLEANED UP.

All Materials:

Site ID:	299298
Operable Unit ID:	979699
Operable Unit:	01
Material ID:	401825
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	.00
Resource Affected:	Surface Water
Oxygenate:	Not reported

Name:	REGION TRANSIT AUTHORITY
Address:	200 CORTLAND AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9702247 / 2002-08-06
Facility ID:	9702247
Facility Type:	ER
DER Facility ID:	190176

CNY CENTRO INC (Continued) **S103570665**

Site ID:	299299
DEC Region:	7
Spill Cause:	Other
Spill Class:	C3
SWIS:	3415
Spill Date:	1997-05-21
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1997-05-21
CID:	370
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1997-05-21
Spill Record Last Update:	2002-08-06
Spiller Name:	ABOVE
Spiller Company:	REGION TRANSIT AUTHORITY
Spiller Address:	200 CORTLAND AVE
Spiller Company:	001
Contact Name:	ABOVE
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	REMOVING 5 TANKS SPILL FROM 4TH TANK 20 GALS SPILL TO GROUND AND MINIMAL TO GROUNDWATER ON SITE SPILL CONTAINED AND CLEANED

Click this hyperlink while viewing on your computer to access
2 additional NY SPILL: record(s) in the EDR Site Report.

AIRS:

Name:	CNY CENTRO INC
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY 13205
DECID:	7311500050
Process ID:	Not reported
Latitude:	Not reported
Longitude:	Not reported
FIPS Code:	Not reported
Auth Type Code:	AFR
Permit Status:	Issued
Auth Status Code:	2
Emissions:	Not reported
Issue date:	07/31/2015
Expired Date:	07/31/2025
Emission Unit date:	Not reported
Contamination:	Not reported
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	Not reported

CNY CENTRO INC (Continued) **S103570665**

Permit Status:	Expired
Auth Status Code:	7
Emissions:	Not reported
Issue date:	11/29/2012
Expired Date:	07/31/2015
Emission Unit date:	Not reported
Contamination:	Not reported
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	Not reported

Permit Status:	Expired
Auth Status Code:	7
Emissions:	Not reported
Issue date:	06/02/1999
Expired Date:	11/29/2012
Emission Unit date:	Not reported
Contamination:	Not reported
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	Not reported

AG133 **CENTRAL BUS CNYRTA MAIN GARAGE** **NY LTANKS** **S121997192**
SW **200 CORTLAND AVE** **NY Spills** **N/A**
1/4-1/2 **SYRACUSE, NY 13202** **NY COOLING TOWERS**
0.427 mi.
2256 ft. **Site 2 of 2 in cluster AG**

Relative: **Lower**
Actual: **390 ft.**

LTANKS:

Name:	CENTRAL NY INC
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9213577 / 1995-12-28
Facility ID:	9213577
Site ID:	275090
Spill Date:	1993-03-09
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	E6
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	BFMATTHE
Referred To:	Not reported
Reported to Dept:	1993-03-09
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1993-03-11
Spill Record Last Update:	1995-12-28
Spiller Name:	Not reported
Spiller Company:	CENTRAL NY INC
Spiller Address:	2OO CORTLAND AVE
Spiller County:	001

CENTRAL BUS CNYRTA MAIN GARAGE (Continued) **S121997192**

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 7
DER Facility ID: 363839
Latitude: Not reported
Longitude: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was BM
03/12/93: MR DAVID RYAN CONTACTED DEC ON3-12-93 AND STATED THAT THE TANK WAS RETESTED AND IT PASSED.
Remarks: TANK TEST FAILURE CLEMENT WILL RETEST

All Materials:
Site ID: 275090
Operable Unit ID: 980879
Operable Unit: 01
Material ID: 403348
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: L
Recovered: .00
Resource Affected: Soil
Oxygenate: Not reported

SPILLS:
Name: CENTRAL BUS CNYRTA MAIN GARAGE
Address: 200 CORTLAND AVE
City,State,Zip: SYRACUSE, NY 13202
Spill Number/Closed Date: 2106666 / 2022-01-14
Facility ID: 2106666
Facility Type: ER
DER Facility ID: 353019
Site ID: 625565
DEC Region: 7
Spill Cause: Equipment Failure
Spill Class: C3
SWIS: 3415
Spill Date: 2021-10-15
Investigator: CFNORRIS
Referred To: Not reported
Reported to Dept: 2021-10-15
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: 2021-10-15
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2021-10-15
Spill Record Last Update: 2022-01-14

CENTRAL BUS CNYRTA MAIN GARAGE (Continued) **S121997192**

Spiller Name:	NATHAN DOW
Spiller Company:	CENTRAL BUS CNYRTA
Spiller Address:	200 CORTLAND AVE
Spiller Company:	999
Contact Name:	NATHAN DOW
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	RP WILL MANAGE EXCAVATION AND SAMPLING. SEVERAL SPILL AREAS IN SOIL OFF TARVIA AT GARAGE.
Remarks:	No drains impacted. 10-15 Gallons lost, c/u pending

All Materials:

Site ID:	625565
Operable Unit ID:	1372706
Operable Unit:	01
Material ID:	2386052
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	15.00
Units:	G
Recovered:	Not reported
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	CENTRO OF SYRACUSE
Address:	200 CORTLAND AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2107306 / 2021-11-08
Facility ID:	2107306
Facility Type:	ER
DER Facility ID:	363839
Site ID:	628220
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2021-11-08
Investigator:	DJLASALL
Referred To:	Not reported
Reported to Dept:	2021-11-08
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2021-11-08
Spill Record Last Update:	2021-11-08
Spiller Name:	Not reported
Spiller Company:	CENTRO OF SYRACUSE
Spiller Address:	Not reported

CENTRAL BUS CNYRTA MAIN GARAGE (Continued) **S121997192**

Spiller Company: 999
Contact Name: NATHAN
Latitude: Not reported
Longitude: Not reported
DEC Memo: spill cleaned up by Centro. NFA
Remarks: cleanup in progress

All Materials:
Site ID: 628220
Operable Unit ID: 1375346
Operable Unit: 01
Material ID: 2388804
Material Code: 0043A
Material Name: antifreeze
Case No.: Not reported
Material FA: Other
Quantity: 1.00
Units: G
Recovered: 1.00
Resource Affected: Impervious Surface
Oxygenate: Not reported

Name: COMMERCIAL/INDUSTRIAL
Address: 200 CORTLAND AVE
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 2306995 / 2023-11-22
Facility ID: 2306995
Facility Type: ER
DER Facility ID: 363839
Site ID: 659026
DEC Region: 7
Spill Cause: Equipment Failure
Spill Class: D4
SWIS: 3415
Spill Date: 2023-11-20
Investigator: DJLASALL
Referred To: Not reported
Reported to Dept: 2023-11-20
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Not reported
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2023-11-20
Spill Record Last Update: 2023-11-22
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: 200 CORTLAND AVE
Spiller Company: 999
Contact Name: CLAIRE DEL SATTI
Latitude: Not reported
Longitude: Not reported

CENTRAL BUS CNYRTA MAIN GARAGE (Continued) **S121997192**

DEC Memo: Petroleum contaminated soil encountered during excavation for utility conduit. PID readings of around 80 ppm noted. Approximately one yard or less of impacted soil segregated for sampling and disposal. Advised caller to treat any further impacted soil encountered within the excavation area in the same manner. NFA
Remarks: Petroleum contamination, cleanup pending

All Materials:
Site ID: 659026
Operable Unit ID: 1405877
Operable Unit: 01
Material ID: 2423200
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Soil
Oxygenate: Not reported

COOLING TOWERS:
Name: Not reported
Address: 200 CORTLAND AVE
City,State,Zip: SYRACUSE, NY 13202
Equipment Unique ID: 7749
Equipment Borough: Not reported
Intended Use: Air Conditioning
Manufacturer: BAC
Model: VF1-036-21L/X
Cooling Capacity: 85
Cooling Capacity Unit: Tonnage
Commissioned Date: 08/10/2001
Inspection Date: 05/04/2022
Date of Bacteriological Collection: 06/06/2022
Date of Legionella Collection: 10/02/2024
Last Legionella Result > 1,000 CFU/mL: lt20
Last Sampled Days: Not reported
Reg Compliant: Not reported
Last Update Days: Not reported
CT Status: Not reported
Equipment Tower Operation Duration: Not reported
Latitude: 43.036343
Longitude: -76.150772

AC134
NNW
1/4-1/2
0.430 mi.
2272 ft.

CATHEDRAL IMMACULATE CON.
420 MONTGOMERY AVE
SYRACUSE, NY

Site 2 of 2 in cluster AC

NY LTANKS **S102677622**
N/A

Relative:
Lower

Actual:
394 ft.

LTANKS:

Name:	CATHEDRAL IMMACULATE CON.
Address:	420 MONTGOMERY AVE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8709428 / 1988-02-05
Facility ID:	8709428
Site ID:	317505
Spill Date:	1988-02-05
Spill Cause:	Tank Overfill
Spill Source:	Tank Truck
Spill Class:	Not reported
Cleanup Ceased:	1988-02-05
SWIS:	3415
Investigator:	VOLLMER
Referred To:	Not reported
Reported to Dept:	1988-02-05
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1988-02-22
Spill Record Last Update:	1988-02-22
Spiller Name:	Not reported
Spiller Company:	MOHAWK VALLEY OIL
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	255926
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was DV 02/05/88: CLEANED UP BY SPILLER.
Remarks:	CLEANED WITH SORBENT BY SPILLER.

All Materials:

Site ID:	317505
Operable Unit ID:	914844
Operable Unit:	01
Material ID:	464751
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	2.00
Units:	G
Recovered:	.00
Resource Affected:	Soil

CATHEDRAL IMMACULATE CON. (Continued) **S102677622**

Oxygenate: Not reported

AH135 **1357 SALINA STREET SOUTH** **US BROWNFIELDS** **1027025371**
SSW **1357 SALINA STREET SOUTH** **FINDS** **N/A**
1/4-1/2 **SYRACUSE, NY 13202**
0.436 mi.
2303 ft. **Site 1 of 2 in cluster AH**

Relative: **Lower**
Actual: **399 ft.**

US BROWNFIELDS:

Name:	1357 Salina Street South
Address:	1357 Salina Street South
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	244990
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	085.-05-15.0
Parcel Size:	0.53
Latitude:	43.033768983
Longitude:	-76.148237007
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase I Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	2020-09-17 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2021-01-12 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported

1357 SALINA STREET SOUTH (Continued) **1027025371**

Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.53
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported

1357 SALINA STREET SOUTH (Continued) **1027025371**

Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2319
Below Poverty Percent:	47.67
Meidan Income:	2749
Meidan Income Number:	3548
Meidan Income Percent:	72.93
Vacant Housing Number:	358
Vacant Housing Percent:	18.68
Unemployed Number:	290
Unemployed Percent:	5.96

Name:	1357 Salina Street South
Address:	1357 Salina Street South
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	244990
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	085.-05-15.0
Parcel Size:	0.53
Latitude:	43.033768983
Longitude:	-76.148237007
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported

1357 SALINA STREET SOUTH (Continued) **1027025371**

Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported

1357 SALINA STREET SOUTH (Continued) **1027025371**

Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.53
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2319
Below Poverty Percent:	47.67
Meidan Income:	2749
Meidan Income Number:	3548
Meidan Income Percent:	72.93
Vacant Housing Number:	358
Vacant Housing Percent:	18.68
Unemployed Number:	290
Unemployed Percent:	5.96

Name:	1357 Salina Street South
Address:	1357 Salina Street South
City,State,Zip:	SYRACUSE, NY 13202
Property ID:	244990
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	085.-05-15.0
Parcel Size:	0.53
Latitude:	43.033768983
Longitude:	-76.148237007
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported

1357 SALINA STREET SOUTH (Continued) **1027025371**

Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	N
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported

1357 SALINA STREET SOUTH (Continued) **1027025371**

RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.53
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2319
Below Poverty Percent:	47.67
Meidan Income:	2749
Meidan Income Number:	3548
Meidan Income Percent:	72.93
Vacant Housing Number:	358
Vacant Housing Percent:	18.68
Unemployed Number:	290
Unemployed Percent:	5.96

FINDS:
Registry ID: 110071090219

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

AI136 **ATLAS SERVICES** **NY LTANKS** **S100129276**
West **TAYLOR ST; KING ST** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.440 mi.
2324 ft. **Site 1 of 2 in cluster AI**

Relative:
Lower

Actual:
390 ft.

LTANKS:

Name:	ATLAS SERVICES
Address:	TAYLOR ST; KING ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8707432 / 1988-01-05
Facility ID:	8707432
Site ID:	243223
Spill Date:	1987-11-25
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	Not reported
Cleanup Ceased:	1988-01-05
SWIS:	3415
Investigator:	AJMARSCH
Referred To:	Not reported
Reported to Dept:	1987-11-30
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1987-12-04
Spill Record Last Update:	1995-06-02
Spiller Name:	Not reported
Spiller Company:	ATLAS SERVICES
Spiller Address:	KING STREET
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	199799
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was JM / / : 12/02/87 RETESTED AND FAILED AT .676 GPH. TANK HAS BEEN PUMPED OUT. WILL REMOVE TANK AS SOON AS POSSIBLE.
Remarks:	4,000 GAL. TANK FAILURE RATE .111. WILL ISOLATE AND RETEST.

All Materials:

Site ID:	243223
Operable Unit ID:	913121
Operable Unit:	01
Material ID:	466382
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00

ATLAS SERVICES (Continued) **S100129276**

Resource Affected: Groundwater
Oxygenate: Not reported

AJ137 **CASTLE REST NURSING HOME** **NY LTANKS** **S104620147**
SSW **116 EAST CASTLE ST** **NY Spills** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.443 mi.
2341 ft. **Site 1 of 2 in cluster AJ**

Relative:
Higher

Actual:
402 ft.

LTANKS:

Name:	SPILL NUMBER 9900884
Address:	116 EAST CASTLE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9900884 / 2000-03-20
Facility ID:	9900884
Site ID:	166430
Spill Date:	1999-04-23
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1999-04-23
CID:	504
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1999-04-23
Spill Record Last Update:	2002-06-03
Spiller Name:	Not reported
Spiller Company:	HOWARD NURSING HM
Spiller Address:	116 EAST CASTLE ST
Spiller County:	001
Spiller Contact:	CALLER
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	140221
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM BM WENT TO TANK PULL, CM TOOK OVER SITE
Remarks:	PULLED TANK, FOUND CONTAMINATION.

All Materials:

Site ID:	166430
Operable Unit ID:	1075649
Operable Unit:	01
Material ID:	308001
Material Code:	0008
Material Name:	diesel

CASTLE REST NURSING HOME (Continued) **S104620147**

Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

SPILLS:

Name:	CASTLE REST NURSING HOME
Address:	116 EAST CASTLE ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9711111 / 1998-01-06
Facility ID:	9711111
Facility Type:	ER
DER Facility ID:	140221
Site ID:	166429
DEC Region:	7
Spill Cause:	Other
Spill Class:	C3
SWIS:	3415
Spill Date:	1998-01-05
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1998-01-05
CID:	351
Water Affected:	Not reported
Spill Source:	Tank Truck
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1998-01-05
Spill Record Last Update:	1998-01-05
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	KEVIN KUTZSCHER
Latitude:	43.0330781
Longitude:	-76.1484564
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM 01/05/98 ON SITE: GRIFFEN INDUSDTRIAL SERVICES ON SITE FOR CLEAN UP, OVER FILL LOSS THROUGH VENT PIPE, STAIN ON BRICKWALL AND GRASSY AREA DOWN BELOW, DEBRIS AND SOIL DRUMMED UP AND DISPOSED.
Remarks:	CALLER STATES THAT THE NURSING HOME OVER ORDERED FUEL AND THAT THERE IS NO WAY TO GAUGE THE TANK TO MEASURE THE AMOUNT OF FUEL IN IT

AJ138 **SPILL NUMBER 9900884** **UST FINDER RELEASE** **1029059726**
SSW **116 EAST CASTLE ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.443 mi.
2341 ft. **Site 2 of 2 in cluster AJ**

Relative:
Higher

Actual:
402 ft.

UST FINDER RELEASE:

Object ID:	249470
Facility ID:	NY140221
Lust ID:	NY9900884
Name:	SPILL NUMBER 9900884
Address:	116 EAST CASTLE ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1999/04/23 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1855
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1484599999999
Y Coord:	43.03308
Latitude:	43.0330799999999
Longitude:	-76.14846

---

139 **HUTCHINGS PSYCH CENTER** **RCRA-VSQG** **1000170847**
NNE **540 CEDAR - BUILDING #1** **NY LTANKS** **NYD980785315**
1/4-1/2 **SYRACUSE, NY 12310** **NY Spills**
0.444 mi. **ICIS**
2342 ft. **FINDS**
ECHO

Relative:
Higher

E MANIFEST
NY MANIFEST

Actual:
403 ft.

RCRA Listings:

Date Form Received by Agency:	20240228
Handler Name:	Hutchings Psychiatric Center
Handler Address:	Cedar St
Handler City,State,Zip:	SYRACUSE, NY 13210-2319
EPA ID:	NYD980785315
Contact Name:	PAUL S BROWN

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Contact Address:		CEDAR ST
Contact City,State,Zip:		SYRACUSE, NY 13210
Contact Telephone:		315-426-3966
Contact Fax:		315-426-3967
Contact Email:		PAUL.BROWN4@OMH.NY.US
Contact Title:		PLANT SUPERINTENDENT
EPA Region:		02
Land Type:		State
Federal Waste Generator Description:		Conditionally Exempt Small Quantity Generator
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Handler Activities
State District Owner:		Ny
State District:		NYSDEC R7
Mailing Address:		CEDAR ST
Mailing City,State,Zip:		SYRACUSE, NY 13210
Owner Name:	New York State Office Of Mental Health	
Owner Type:		State
Operator Name:	Hutchings Psychiatric Center	
Operator Type:		State
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
202 GPRA Corrective Action Baseline:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No
Addressed Significant Non-Complier Universe:		No
Significant Non-Complier With a Compliance Schedule Universe:		No
Financial Assurance Required:		Not reported
Handler Date of Last Change:		20240229
Recognized Trader-Importer:		No
Recognized Trader-Exporter:		No
Importer of Spent Lead Acid Batteries:		No

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	D002
Waste Description:	Corrosive Waste
Waste Code:	D003
Waste Description:	Reactive Waste
Waste Code:	D008
Waste Description:	Lead
Waste Code:	D009
Waste Description:	Mercury
Waste Code:	D010
Waste Description:	Selenium
Waste Code:	D011
Waste Description:	Silver
Waste Code:	D024
Waste Description:	M-Cresol
Waste Code:	D026
Waste Description:	Cresol
Waste Code:	P001
Waste Description:	2h-1-Benzopyran-2-One, 4-Hydroxy-3-(3-Oxo-1-Phenylbutyl)-, & Salts, When Present At Concentrations Greater Than 0.3% (Or) Warfarin, & Salts, When Present At Concentrations Greater Than 0.3%
Waste Code:	P042
Waste Description:	1,2-Benzenediol, 4-[1-Hydroxy-2-(Methylamino)Ethyl]-, (R)- (Or) Epinephrine
Waste Code:	P075
Waste Description:	Nicotine, & Salts (Or) Pyridine, 3-(1-Methyl-2-Pyrrolidinyl)-,(S)-, & Salts
Waste Code:	U034
Waste Description:	Acetaldehyde, Trichloro- (Or) Chloral
Waste Code:	U129
Waste Description:	Cyclohexane, 1,2,3,4,5,6-Hexachloro-, (1alpha, 2alpha, 3beta, 4alpha, 5alpha, 6beta)- (Or) Lindane
Waste Code:	U150
Waste Description:	L-Phenylalanine, 4-[Bis(2-Chloroethyl)Amino]- (Or) Melphalan

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Waste Code: U154
Waste Description: Methanol (I) (Or) Methyl Alcohol (I)

Waste Code: U205
Waste Description: Selenium Sulfide (Or) Selenium Sulfide Ses2 (R,T)

Waste Code: X002
Waste Description: Not Defined

Handler - Owner Operator:
Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 44 HOLLAND AVE
Owner/Operator City,State,Zip: ALBANY, NY 12229
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 44 HOLLAND AVE
Owner/Operator City,State,Zip: ALBANY, NY 12229
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HUTCHINGS PSYCHIATRIC CENTER
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 620 MADISON AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-426-3966
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: 315-426-3967
Owner/Operator Email: PAUL.BROWN4@OMH.NY.GOV

Owner/Operator Indicator: Operator
Owner/Operator Name: HUTCHINGS PSYCHIATRIC CENTER
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Owner/Operator Indicator: Operator
Owner/Operator Name: HUTCHINGS PSYCHIATRIC CENTER
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 620 MADISON AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-426-3966
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: 315-426-3967
Owner/Operator Email: PAUL.BROWN4@OMH.NY.GOV

Owner/Operator Indicator: Operator
Owner/Operator Name: HUTCHINGS PSYCHIATRIC CENTER
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HUTCHINGS PSYCHIATRIC CENTER
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 620 MADISON AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-426-3966
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: 315-426-3967
Owner/Operator Email: PAUL.BROWN4@OMH.NY.GOV

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 620 MADISON ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 75 NEW SCOTLAND AVE
Owner/Operator City,State,Zip: ALBANY, NY 12208
Owner/Operator Telephone: 518-549-5118
Owner/Operator Telephone Ext: Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Owner/Operator Fax: Not reported
Owner/Operator Email: ERICA.CRUDEN@OMH.NY.GOV

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 75 NEW SCOTLAND AVE
Owner/Operator City,State,Zip: ALBANY, NY 12208
Owner/Operator Telephone: 518-549-5118
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: ERICA.CRUDEN@OMH.NY.GOV

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 620 MADISON ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HUTCHINGS PSYCHIATRIC CENTER
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 620 MADISON AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13210
Owner/Operator Telephone: 315-426-3966
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: 315-426-3967
Owner/Operator Email: PAUL.BROWN4@OMH.NY.GOV

Owner/Operator Indicator: Owner
Owner/Operator Name: OWNERNAME
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HUTCHINGS PSYCHIATRIC CENTER
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HUTCHINGS PSYCHIATRIC CENTER
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 75 NEW SCOTLAND AVE
Owner/Operator City,State,Zip: ALBANY, NY 12208
Owner/Operator Telephone: 518-549-5118
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: JIMMY.NG@OMH.NY.GOV

Owner/Operator Indicator: Owner
Owner/Operator Name: NEW YORK STATE OFFICE OF MENTAL HEALTH
Legal Status: State
Date Became Current: 19780401
Date Ended Current: Not reported
Owner/Operator Address: 75 NEW SCOTLAND AVE
Owner/Operator City,State,Zip: ALBANY, NY 12208
Owner/Operator Telephone: 518-549-5118
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: JIMMY.NG@OMH.NY.GOV

Historic Generators:
Receive Date: 19990708
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Not a generator, verified
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060430

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20071028
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19850102
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060501
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20071029
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20110318
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20110504
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20180622
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20190701
Handler Name: HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	No
Electronic Manifest Broker:	No

Receive Date:	20230905
Handler Name:	HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description:	Small Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	No
Electronic Manifest Broker:	No

Receive Date:	20240228
Handler Name:	HUTCHINGS PSYCHIATRIC CENTER
Federal Waste Generator Description:	Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner:	Ny
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	No
Electronic Manifest Broker:	No

List of NAICS Codes and Descriptions:

NAICS Code:	62221
NAICS Description:	Psychiatric And Substance Abuse Hospitals

Has the Facility Received Notices of Violations:

Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Evaluation Action Summary:

Evaluation Date:	20170601
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION
Evaluation Responsible Person Identifier:	NYBRS
Evaluation Responsible Sub-Organization:	R7
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

LTANKS:

Name:	HUTCHINGS PSYCH CENTER
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8802339 / 1990-01-24
Facility ID:	8802339
Site ID:	78437
Spill Date:	1988-06-15
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1990-01-24
SWIS:	3415
Investigator:	GREGG
Referred To:	Not reported
Reported to Dept:	1918-06-15
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1988-06-20
Spill Record Last Update:	1990-01-25
Spiller Name:	Not reported
Spiller Company:	HUTCHING PSYCH CENTER
Spiller Address:	SEE ABOVE
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	169331
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was TG 06/14/88: BOTH TANKS WERE PREVIOUSLY TESTED ON 06/14/88. BOTH FAILED. -.6414 GPH & -.4962GPH.
Remarks:	TANK TEST FAILURES FROM FIBERGLASS TANKS THAT HAVE AN AIR POCKET THAT CAN NOT BE RELIEVED.

All Materials:

Site ID:	78437
Operable Unit ID:	917666
Operable Unit:	01
Material ID:	457910
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

Name:	HUTCHINGS
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8710954 / 1988-06-09
Facility ID:	8710954
Site ID:	203614
Spill Date:	1988-03-31
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1988-06-09
SWIS:	3415
Investigator:	AJMARSCH
Referred To:	Not reported
Reported to Dept:	1988-03-31
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1988-04-06
Spill Record Last Update:	1988-06-14
Spiller Name:	Not reported
Spiller Company:	NYS OGS (HUTCHINGS PSYCH)
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	169331
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was JM
Remarks:	06/09/88: TANK WAS RETESTED TIGHT. PIPING WAS REPAIRED IN MAY OF 88. CONTACT GERRY MARTIN EXT. 4992 2500 GAL.TANK TEST OK PIPING FAILED HORNER EZ AT -0.1199 GPH.

All Materials:

Site ID:	203614
Operable Unit ID:	916818
Operable Unit:	01
Material ID:	462699
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

SPILLS:

Name:	HUTCHINGS PSYCHIATRIC CTR
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0209541 / 2002-12-17
Facility ID:	0209541
Facility Type:	ER
DER Facility ID:	169331
Site ID:	203612
DEC Region:	7
Spill Cause:	Human Error
Spill Class:	C3
SWIS:	3415
Spill Date:	2002-12-16
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	2002-12-17
CID:	211
Water Affected:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Spill Source:	Tank Truck
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2002-12-17
Spill Record Last Update:	2002-12-17
Spiller Name:	DAN STOWELL
Spiller Company:	GRIFFITH ENERGY
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0461809
Longitude:	-76.1420831
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	DRIVER DID NOT SHUT NOZZLE COMPLETELY AFTER FILL UP - 1/2 GAL OF PRODUCT CLEANED UP

All Materials:

Site ID:	203612
Operable Unit ID:	862621
Operable Unit:	01
Material ID:	512962
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	1.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	HUTCHINGS PSYC CENTER
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0460027 / 2004-08-31
Facility ID:	0460027
Facility Type:	ER
DER Facility ID:	169331
Site ID:	203613
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D3
SWIS:	3415
Spill Date:	2004-06-22
Investigator:	CXROSSI
Referred To:	Not reported
Reported to Dept:	2004-06-23
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Non Major Facility > 1,100 gal
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Cleanup Meets Std:	False
Last Inspection:	2004-06-24
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-07-23
Spill Record Last Update:	2004-08-31
Spiller Name:	RICK HOWARD
Spiller Company:	HUTCHINGS
Spiller Address:	500 CEDAR ST
Spiller Company:	001
Contact Name:	RICK HOWARD
Latitude:	43.0461730
Longitude:	-76.1420780
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CTR soil borings in tank pit area revealed localized and minor petroleum contamination.
Remarks:	believed to be less than 10 gallons. filled tank for tightness test and it leaked around manhole. Orginally listed as spill number 0403194, and somehow listed also as 0000031.

All Materials:

Site ID:	203613
Operable Unit ID:	890843
Operable Unit:	01
Material ID:	485586
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	HUTCHINGS
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8910136 / 1990-01-23
Facility ID:	8910136
Facility Type:	ER
DER Facility ID:	169331
Site ID:	203615
DEC Region:	7
Spill Cause:	Human Error
Spill Class:	Not reported
SWIS:	3415
Spill Date:	1990-01-23
Investigator:	GREGG
Referred To:	Not reported
Reported to Dept:	1990-01-23
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	1990-01-23

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	HUTCHINGS PSYCH CENTER
Spiller Address:	620 MADISON
Spiller Company:	001
Contact Name:	Not reported
Latitude:	43.0461809
Longitude:	-76.1420831
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was TG
Remarks:	EMPLOYEE DROPPED CONTAINER OF BLEACH. SITUATION NUTRALIZED.

All Materials:

Site ID:	203615
Operable Unit ID:	935224
Operable Unit:	01
Material ID:	443257
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Site ID:	203615
Operable Unit ID:	935224
Operable Unit:	01
Material ID:	443258
Material Code:	0466A
Material Name:	bleach
Case No.:	Not reported
Material FA:	Other
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	TRANSPORTATION DEPT. OF H
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0403194 / 2004-12-21
Facility ID:	0403194
Facility Type:	ER
DER Facility ID:	169331
Site ID:	78436
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D3

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

SWIS:	3415
Spill Date:	2004-06-22
Investigator:	CXROSSI
Referred To:	Not reported
Reported to Dept:	2004-06-23
CID:	444
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	2004-06-22
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-06-23
Spill Record Last Update:	2004-12-21
Spiller Name:	RICK HOWARD
Spiller Company:	TRANSPORTATION DEPT. OF H
Spiller Address:	500 CEDAR ST.
Spiller Company:	001
Contact Name:	RICK HOWARD
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was
Remarks:	BELEIAVED TO BE LESS THAN 10 GALLONS, TIGHTENING TANK AND IT LEAKED, LEAKED INTO A CONTAINED AREA, NO CLEANUP IN PROGRESS, SPILL IS BELOW THE MANHOLE

All Materials:

Site ID:	78436
Operable Unit ID:	886640
Operable Unit:	01
Material ID:	490787
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	Not reported
Recovered:	5.00
Resource Affected:	Soil
Oxygenate:	Not reported

ICIS:

Enforcement Action ID:	02-2009-0832
FRS ID:	110004392924
Action Name:	Hutchings Psychiatric Center - NYSOMH
Facility Name:	HUTCHINGS PSYCHIATRIC CENTER
Facility Address:	500 CEDAR ST SYRACUSE, NY 132102319
Enforcement Action Type:	RCRA 3008A AO For Comp And/Or Penalty
Facility County:	ONONDAGA
Program System Acronym:	RCRAINFO
Enforcement Action Forum Desc:	Administrative - Formal
EA Type Code:	3008A

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Facility SIC Code:	Not reported
Federal Facility ID:	Not reported
Latitude in Decimal Degrees:	43.04623
Longitude in Decimal Degrees:	-76.1422
Permit Type Desc:	Not reported
Program System Acronym:	NYD980785315
Facility NAICS Code:	Not reported
Tribal Land Code:	Not reported

Facility Name:	HUTCHINGS PSYCHIATRIC CENTER
Address:	500 CEDAR ST
Tribal Indicator:	N
Fed Facility:	No
NAIC Code:	Not reported
SIC Code:	Not reported

Facility Name:	HUTCHINGS PSYCHIATRIC CENTER
Address:	500 CEDAR ST
Tribal Indicator:	N
Fed Facility:	No
NAIC Code:	Not reported
SIC Code:	Not reported

FINDS:
Registry ID: 110004392924

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1000170847
Registry ID:	110004392924

DFR URL:

Name:	HUTCHINGS PSYCHIATRIC CENTER
Address:	500 CEDAR ST
City,State,Zip:	SYRACUSE, NY 13210

E MANIFEST:

Manifest Tracking Number:	016132306FLE
Last Updated Date:	20230719
Shipped Date:	20230620
Received Date:	20230621
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR STREET
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13210
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR STREET
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13210
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD002200046
Designated Facility Name:	Cycle Chem, Inc.
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	217 SOUTH FIRST STREET
Designated Facility Mail City:	ELIZABETH
Designated Facility Mail Zip:	07206
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	217 SOUTH FIRST STREET
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	ELIZABETH
Designated Facility Location Zip:	07206
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	012191539FLE
Last Updated Date:	20191017
Shipped Date:	20181114
Received Date:	20181121
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Web
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR ST
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13210-2319
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR ST
Generator Mail Street 2:	ATTN: ENVIRONMENTAL MANAGER
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13210
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	PAD067098822
Designated Facility Name:	Cyclechem Inc

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	550 INDUSTRIAL DR
Designated Facility Mail City:	LEWISBERRY
Designated Facility Mail Zip:	17339
Designated Facility Mail State:	PA
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	550 INDUSTRIAL DR
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	LEWISBERRY
Designated Facility Location Zip:	17339
Designated Facility Location State:	PA
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	012191541FLE
Last Updated Date:	20190212
Shipped Date:	20181119
Received Date:	20181120
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR ST
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13210-2319
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR ST
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13210
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	MID048090633
Designated Facility Name:	Wayne Disposal Inc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	49350 N I94 SERVICE DR
Designated Facility Mail City:	BELLEVILLE
Designated Facility Mail Zip:	48111
Designated Facility Mail State:	MI
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	49350 N I94 SERVICE DR
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	BELLEVILLE
Designated Facility Location Zip:	48111
Designated Facility Location State:	MI
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	023619405JJK

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Last Updated Date:	20230712
Shipped Date:	20230703
Received Date:	20230703
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR STREET
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13210
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR STREET
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13210
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	NJD002200046
Designated Facility Name:	Cycle Chem, Inc.
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	217 SOUTH FIRST STREET
Designated Facility Mail City:	ELIZABETH
Designated Facility Mail Zip:	07206
Designated Facility Mail State:	NJ
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	217 SOUTH FIRST STREET
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	ELIZABETH
Designated Facility Location Zip:	07206
Designated Facility Location State:	NJ
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	017166820FLE
Last Updated Date:	20220707
Shipped Date:	20220518
Received Date:	20220617
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR STREET
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13210
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 Cedar Street
Generator Mail Street 2:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Generator Mail City:	Syracuse
Generator Mail Zip:	13210
Generator Mail State:	NY
Generator Contact Company Name:	Hutchings Psychiatric Center
Designated Facility EPA ID:	ARD069748192
Designated Facility Name:	Clean Harbors El Dorado Llc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	309 American Circle
Designated Facility Mail City:	El Dorado
Designated Facility Mail Zip:	71730
Designated Facility Mail State:	AR
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	309 American Circle
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	El Dorado
Designated Facility Location Zip:	71730
Designated Facility Location State:	AR
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	017166821FLE
Last Updated Date:	20220705
Shipped Date:	20220518
Received Date:	20220614
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR STREET
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13210
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 Cedar Street
Generator Mail Street 2:	Not reported
Generator Mail City:	Syracuse
Generator Mail Zip:	13210
Generator Mail State:	NY
Generator Contact Company Name:	Hutchings Psychiatric Center
Designated Facility EPA ID:	NCD000648451
Designated Facility Name:	Clean Harbors Reidsville Llc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	208 Watlington Industrial Drive
Designated Facility Mail City:	Reidsville
Designated Facility Mail Zip:	27320
Designated Facility Mail State:	NC
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	208 Watlington Industrial Drive
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	Reidsville
Designated Facility Location Zip:	27320

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Designated Facility Location State:	NC
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N
Manifest Tracking Number:	003463458GBF
Last Updated Date:	20190115
Shipped Date:	20181107
Received Date:	20181203
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psych Center
Generator Location Street Number:	Not reported
Generator Location Street 1:	540 CEDAR - BUILDING #1
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	12310
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	540 Cedar - Building #1
Generator Mail Street 2:	Not reported
Generator Mail City:	Syracuse
Generator Mail Zip:	12310
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	VTR000517052
Designated Facility Name:	Not reported
Designated Facility Mail Street Number:	54
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	54 AVENUE D
Designated Facility Mail City:	WILLISTON
Designated Facility Mail Zip:	05495
Designated Facility Mail State:	VT
Designated Facility Location Street Number:	54
Designated Facility Location Street 1:	54 AVENUE D
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	WILLISTON
Designated Facility Location Zip:	05495
Designated Facility Location State:	VT
Designated Facility Contact Company Name:	Enpro Services Of Vermont, Inc.
Manifest Residue Indicator:	N
Rejection Indicator:	N
Manifest Tracking Number:	010983353FLE
Last Updated Date:	20190212
Shipped Date:	20180706
Received Date:	20180710
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR ST
Generator Location Street 2:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13210-2319
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR ST
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13210
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	MID048090633
Designated Facility Name:	Wayne Disposal Inc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	49350 N I94 SERVICE DR
Designated Facility Mail City:	BELLEVILLE
Designated Facility Mail Zip:	48111
Designated Facility Mail State:	MI
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	49350 N I94 SERVICE DR
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	BELLEVILLE
Designated Facility Location Zip:	48111
Designated Facility Location State:	MI
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	010983384FLE
Last Updated Date:	20190212
Shipped Date:	20180904
Received Date:	20180905
Manifest Status:	Signed
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR ST
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13210-2319
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 CEDAR ST
Generator Mail Street 2:	Not reported
Generator Mail City:	SYRACUSE
Generator Mail Zip:	13210
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	MID048090633
Designated Facility Name:	Wayne Disposal Inc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	49350 N I94 SERVICE DR
Designated Facility Mail City:	BELLEVILLE
Designated Facility Mail Zip:	48111

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Designated Facility Mail State:	MI
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	49350 N I94 SERVICE DR
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	BELLEVILLE
Designated Facility Location Zip:	48111
Designated Facility Location State:	MI
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	015217859FLE
Last Updated Date:	20201217
Shipped Date:	20201008
Received Date:	20201024
Manifest Status:	Corrected
Submission Type:	DataImage5Copy
Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR STREET
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13210
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 Cedar Street
Generator Mail Street 2:	Not reported
Generator Mail City:	Syracuse
Generator Mail Zip:	13210
Generator Mail State:	NY
Generator Contact Company Name:	Hutchings Psychiatric Center
Designated Facility EPA ID:	ARD069748192
Designated Facility Name:	Clean Harbors El Dorado Llc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	309 American Circle
Designated Facility Mail City:	El Dorado
Designated Facility Mail Zip:	71730
Designated Facility Mail State:	AR
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	309 American Circle
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	El Dorado
Designated Facility Location Zip:	71730
Designated Facility Location State:	AR
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

Manifest Tracking Number:	011861934FLE
Last Updated Date:	20181009
Shipped Date:	20180824
Received Date:	20180912
Manifest Status:	Signed
Submission Type:	DataImage5Copy

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Origin Type:	Service
Generator EPA ID:	NYD980785315
Generator Name:	Hutchings Psychiatric Center
Generator Location Street Number:	Not reported
Generator Location Street 1:	500 CEDAR STREET
Generator Location Street 2:	Not reported
Generator Location City:	SYRACUSE
Generator Location State:	NY
Generator Location Zip:	13210
Generator Mail Street Number:	Not reported
Generator Mail Street 1:	500 Cedar Street
Generator Mail Street 2:	Not reported
Generator Mail City:	Syracuse
Generator Mail Zip:	13210
Generator Mail State:	NY
Generator Contact Company Name:	Not reported
Designated Facility EPA ID:	ARD069748192
Designated Facility Name:	Clean Harbors El Dorado Llc
Designated Facility Mail Street Number:	Not reported
Designated Facility Mail Street 1:	Not reported
Designated Facility Mail Street 2:	309 American Circle
Designated Facility Mail City:	El Dorado
Designated Facility Mail Zip:	71730
Designated Facility Mail State:	AR
Designated Facility Location Street Number:	Not reported
Designated Facility Location Street 1:	309 American Circle
Designated Facility Location Street 2:	Not reported
Designated Facility Location City:	El Dorado
Designated Facility Location Zip:	71730
Designated Facility Location State:	AR
Designated Facility Contact Company Name:	Not reported
Manifest Residue Indicator:	N
Rejection Indicator:	N

PCB Information:

Manifest Tracking Number:	011861937FLE
Waste Line Number:	1
Article or Container ID:	082415HUT0353
Bulk Identity:	Not reported
Date of Removal:	20180815
Load Type:	Container
Load Type Description:	Container
Waste Type:	Labpack PCBs For Secure Chemical Landfill
Weight:	49.8951521416587

Transporter:

Manifest Tracking Number:	011861937FLE
Transporter Line Number:	1
Transporter EPA ID:	MAD039322250
Transporter Name:	Clean Harbors Environmental Services, Inc.
Manifest Tracking Number:	011861937FLE
Transporter Line Number:	2
Transporter EPA ID:	NYD982792814
Transporter Name:	Franks Vacuum Truck Service Inc

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Waste Line:

Manifest Tracking Number:	011861937FLE
Waste Line Number:	1
U.S. DOT Hazardous Indicator:	Y
U.S. DOT ID Number:	UN3432
U.S. DOT Description:	Rq, Un3432, Polychlorinated Biphenyls, Solid (Pcb Ballasts), 9, Pg Iii (Pcb), (Tsca Exempt)
Non-Hazardous Waste Description:	Not reported
Number of Containers:	1
Container Type Code:	DF
Container Type Description:	Fiberboard or plastic drums, barrels, kegs
Waste Quantity:	45
Quantity Unit of Measure Code:	K
Quantity Unit of Measure Description:	Kilograms
Waste Quantity, in Tons:	0.04961247
Acute Waste Quantity, in Tons:	0
Non-Acute Waste Quantity, in Tons:	0.04961247
Waste Quantity, in Kilograms:	45
Acute Waste Quantity, in Kilograms:	0
Non-Acute Waste Quantity, in Kilorgrams:	45
Management Method Code:	H141
Management Method Description:	STORAGE, BULKING AND/OR TRANSFER OFF SITE
Waste Residue Indicator:	N
Quantity Discrepancy Indicator:	N
Waste Type Discrepancy Indicator:	N
Waste Density:	Not reported
Waste Density Unit of Measure Code:	Not reported
Waste Density Unit of Measure Description:	Not reported
Form Code:	Not reported
Form Code Description:	Not reported
Source Code:	Not reported
Source Code Description:	Not reported
Waste Minimization Code:	Not reported
Waste Minimization Code Description:	Not reported
Consent Number:	Not reported
EPA Waste Indicator:	N
Federal Waste Codes:	Not reported
Quantity Haz Kg:	0
Quantity Haz Tons:	0
Quantity Non Haz Kg:	45
Quantity Non Haz Tons:	0.04961247
State Waste Codes:	Not reported

Click this hyperlink while viewing on your computer to access
4 additional US EManifest: record(s) in the EDR Site Report.

NY MANIFEST:

EPA ID:	NYD980785315
Country:	USA
Name:	Hutchings Psychiatric Center
Address:	500 CEDAR ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13210-2302
Zip 4:	Not reported
Location Address 1:	500 CEDAR STREET
Location Address 2:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Location City,State,Zip: SYRACUSE, NY 13210
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: Hutchings Psychiatric Center
Mailing Contact: Dennis M. Daley
Mailing Address 1: 620 MADISON STREET
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13210
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154734980

Manifest Data:
Document ID: MDC0844341
Manifest Status: Not reported
Trans1 State ID: HWH123
Year: 2001
Trans2 State ID: HWH822301
Generator Ship Date: 01/17/2001
Trans1 Recv Date: 01/17/2001
Trans2 Recv Date: 01/18/2001
TSD Site Recv Date: 01/25/2001
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD980785315
Trans1 EPA ID: SCR000075150
Trans2 EPA ID: SCR000074591
TSDF ID 1: MDD980554653
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code 1: B007
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 00221
Units: Kilograms
Number of Containers: 001
Container Type: Metal drums, barrels, kegs
Handling Method: Burn
Specific Gravity: 01.00

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Document ID:	NJA3205453
Manifest Status:	Not reported
Trans1 State ID:	08690
Year:	2001
Trans2 State ID:	H10364
Generator Ship Date:	01/17/2001
Trans1 Recv Date:	01/17/2001
Trans2 Recv Date:	01/18/2001
TSD Site Recv Date:	01/25/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	SCR000075150
Trans2 EPA ID:	SCR000074591
TSDF ID 1:	NJD002182897
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00362
Units:	Pounds
Number of Containers:	001
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/03/2014
Trans1 Recv Date:	04/03/2014
Trans2 Recv Date:	04/09/2014
TSD Site Recv Date:	04/19/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Manifest Tracking Number:	007469999FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code a:	Ignitable Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	50
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/03/2014
Trans1 Recv Date:	04/03/2014
Trans2 Recv Date:	04/09/2014
TSD Site Recv Date:	04/19/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	007469999FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code a:	Selenium
Waste Code b:	Silver
Waste Code c:	Cresol
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/03/2014
Trans1 Recv Date:	04/03/2014
Trans2 Recv Date:	04/09/2014
TSD Site Recv Date:	04/19/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	007469999FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Mercury
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Recycle
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/03/2014
Trans1 Recv Date:	04/03/2014
Trans2 Recv Date:	04/09/2014
TSD Site Recv Date:	04/19/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	007469999FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code a:	2h-1-Benzopyran-2-One, 4-Hydroxy-3-(3-Oxo-1-Phenylbutyl)-, & Salts, When Present At Concentrations Greater Than 0.3% (Or) Warfarin, & Salts, When Present At Concentrations Greater Than 0.3%
Waste Code b:	1,2-Benzenediol, 4-[1-Hydroxy-2-(Methylamino)Ethyl]-, (R)- (Or) Epinephrine
Waste Code c:	Nicotine, & Salts (Or) Pyridine, 3-(1-Methyl-2-Pyrrolidinyl)-,(S)-, & Salts
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1
Units:	Pounds

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Number of Containers: 1
Container Type: Fiber or plastic boxes, cartons, cases
Handling Method: Burn
Specific Gravity: 1

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: MAD039322250
Year: 2018
Trans2 State ID: NYD982792814
Generator Ship Date: 04/03/2014
Trans1 Recv Date: 04/03/2014
Trans2 Recv Date: 04/09/2014
TSD Site Recv Date: 04/19/2014
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD980785315
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: ARD069748192
TSDF ID 2: Not reported
Manifest Tracking Number: 007469999FLE
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H040
Waste Code a: Ignitable Waste
Waste Code b: Not reported
Waste Code c: Not reported
Waste Code e: Not reported
Waste Code f: Not reported
Waste Code g: Not reported
Waste Code 1: Not reported
Waste Code 2: Not reported
Waste Code 3: Not reported
Waste Code 4: Not reported
Waste Code 5: Not reported
Waste Code 6: Not reported
Quantity: 30
Units: Pounds
Number of Containers: 1
Container Type: Fiber or plastic boxes, cartons, cases
Handling Method: Burn
Specific Gravity: 1

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD080631369
Year: 2018
Trans2 State ID: NJD054126164

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Generator Ship Date:	07/22/2014
Trans1 Recv Date:	07/22/2014
Trans2 Recv Date:	07/25/2014
TSD Site Recv Date:	07/30/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD980536593
TSDF ID 2:	Not reported
Manifest Tracking Number:	000613369VES
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Ignitable Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	5
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/15/2015
Trans1 Recv Date:	04/15/2015
Trans2 Recv Date:	04/24/2015
TSD Site Recv Date:	04/29/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

TSDF ID 2:	Not reported
Manifest Tracking Number:	008016853FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code a:	2h-1-Benzopyran-2-One, 4-Hydroxy-3-(3-Oxo-1-Phenylbutyl)-, & Salts, When Present At Concentrations Greater Than 0.3% (Or) Warfarin, & Salts, When Present At Concentrations Greater Than 0.3%
Waste Code b:	Nicotine, & Salts (Or) Pyridine, 3-(1-Methyl-2-Pyrrolidinyl)-,(S)-, & Salts
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	1
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/15/2015
Trans1 Recv Date:	04/15/2015
Trans2 Recv Date:	04/24/2015
TSD Site Recv Date:	04/29/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	008016853FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code a:	Selenium
Waste Code b:	Silver
Waste Code c:	Cresol
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	12
Units:	Pounds
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	MAD039322250
Year:	2018
Trans2 State ID:	NYD982792814
Generator Ship Date:	04/15/2015
Trans1 Recv Date:	04/15/2015
Trans2 Recv Date:	04/24/2015
TSD Site Recv Date:	04/29/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD980785315
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	008016853FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code a:	Corrosive Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported

HUTCHINGS PSYCH CENTER (Continued) **1000170847**

Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	180
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Burn
Specific Gravity:	1

Click this hyperlink while viewing on your computer to access
60 additional NY MANIFEST: record(s) in the EDR Site Report.

140
NE
1/4-1/2
0.453 mi.
2394 ft.

SUNY UPSTATE MEDICAL UNIVERSITY IHP **NY SWF/LF** **S121994678**
505 IRVING AVE **NY COOLING TOWERS** **N/A**
SYRACUSE, NY 13210

Relative:
Higher

Actual:
421 ft.

SWF/LF:

Name:	SUNY UPSTATE MEDICAL UNIVERSITY IHP
Address:	505 IRVING AVE
City,State,Zip:	SYRACUSE, NY 13210
Flag:	INACTIVE
Region Code:	7
Phone Number:	Not reported
Owner Name:	Not reported
Owner Type:	Not reported
Owner Address:	Not reported
Owner Addr2:	Not reported
Owner City,St,Zip:	Not reported
Owner Email:	Not reported
Owner Phone:	Not reported
Contact Name:	Not reported
Contact Address:	Not reported
Contact Addr2:	Not reported
Contact City,St,Zip:	Not reported
Contact Email:	Not reported
Contact Phone:	Not reported
Activity Desc:	RMW - permit
Activity Number:	[34JP0090]
Active:	No
East Coordinate:	407347
North Coordinate:	4766415
Accuracy Code:	1.1 - Obtained from original submission and unverified process
Regulatory Status:	Permit
Waste Type:	Not reported
Authorization #:	7-3115-00555
Authorization Date:	Not reported
Expiration Date:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported

SUNY UPSTATE MEDICAL UNIVERSITY IHP (Continued) **S121994678**

Laste Date: Not reported

COOLING TOWERS:

Name:	Not reported
Address:	505 IRVING AVE
City,State,Zip:	SYRACUSE, NY 13210
Equipment Unique ID:	5094
Equipment Borough:	Not reported
Intended Use:	Air Conditioning
Manufacturer:	BALTIMORE AIR COIL
Model:	3482-C
Cooling Capacity:	900
Cooling Capacity Unit:	Tonnage
Commissioned Date:	04/01/2014
Inspection Date:	03/01/2022
Date of Bacteriological Collection:	03/01/2022
Date of Legionella Collection:	11/05/2024
Last Legionella Result > 1,000 CFU/mL:	lt20
Last Sampled Days:	Not reported
Reg Compliant:	Not reported
Last Update Days:	Not reported
CT Status:	Not reported
Equipment Tower Operation Duration:	Not reported
Latitude:	43.04525
Longitude:	-76.137703

AF141 **COUNTY SEWER ROW** **UST FINDER RELEASE** **1029074682**
WNW **CLINTON AND WEST ONONDAGA ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.455 mi.
2405 ft. **Site 4 of 4 in cluster AF**

Relative: **Lower**
Actual: **391 ft.**

UST FINDER RELEASE:

Object ID:	249443
Facility ID:	NY335966
Lust ID:	NY706121
Name:	COUNTY SEWER ROW
Address:	CLINTON AND WEST ONONDAGA ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	2007/08/29 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	983
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No

COUNTY SEWER ROW (Continued) **1029074682**

Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.15325
Y Coord:	43.0436300000001
Latitude:	43.04363
Longitude:	-76.15325

---

142 **SYRACUSE UNIVERSITY** **NY LTANKS** **S103479036**
ESE **M17 SKYTOP RD** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.458 mi.
2420 ft.

Relative: **Higher**

Actual: **560 ft.**

LTANKS:

Name:	SYRACUSE UNIVERSITY
Address:	M17 SKYTOP RD
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9805513 / 1998-09-21
Facility ID:	9805513
Site ID:	156486
Spill Date:	1998-08-03
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1998-08-03
CID:	233
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1998-08-03
Spill Record Last Update:	1998-12-01
Spiller Name:	PAT STOCK
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	111 COLLEGE PL
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	132435
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	tank was found to be bad when doing unrelated digging in area tank

SYRACUSE UNIVERSITY (Continued) **S103479036**

has been pulled and soil stock pilled

AI143 **ATLAS LINEN** **UST FINDER RELEASE** **1029069745**
WSW **320 WEST TAYLOR ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.461 mi.
2435 ft. **Site 2 of 2 in cluster AI**

Relative: **Lower**
Actual: **390 ft.**

UST FINDER RELEASE:

Object ID:	249446
Facility ID:	NY263105
Lust ID:	NY1641
Name:	ATLAS LINEN
Address:	320 WEST TAYLOR ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	2000/05/09 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	517
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1531199999999
Y Coord:	43.0388400000001
Latitude:	43.03884
Longitude:	-76.15312

AK144 **PRESIDENTIAL PLAZA** **NY LTANKS** **S100128205**
North **90 PRESIDENTIAL PLAZA** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.464 mi.
2448 ft. **Site 1 of 3 in cluster AK**

Relative: **Lower**
Actual: **401 ft.**

LTANKS:

Name:	PRESIDENTIAL PLAZA
Address:	90 PRESIDENTIAL PLAZA
City,State,Zip:	SYRACUSE, NY

PRESIDENTIAL PLAZA (Continued) **S100128205**

Spill Number/Closed Date:	8906852 / 1989-10-12
Facility ID:	8906852
Site ID:	297379
Spill Date:	1989-10-12
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Cleanup Ceased:	1989-10-12
SWIS:	3415
Investigator:	GREGG
Referred To:	Not reported
Reported to Dept:	1989-10-12
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	Not reported
Spill Record Last Update:	2003-12-02
Spiller Name:	Not reported
Spiller Company:	SUTTON COMPANY
Spiller Address:	200 LOEW BLDG
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	240602
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was TG
Remarks:	FOUN CONTAMINATED SOIL WHILE REMOVING 2 10000 GAL TANKS.

All Materials:

Site ID:	297379
Operable Unit ID:	934638
Operable Unit:	01
Material ID:	443668
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

AK145 **PRESIDENTIAL PLAZA** **UST FINDER RELEASE** **1029067936**
North **90 PRESIDENTIAL PLAZA** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.464 mi.
2448 ft. **Site 2 of 3 in cluster AK**

Relative: **Lower**
Actual: **401 ft.**

UST FINDER RELEASE:

Object ID:	249519
Facility ID:	NY240602
Lust ID:	NY8906852
Name:	PRESIDENTIAL PLAZA
Address:	90 PRESIDENTIAL PLAZA
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1989/10/12 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	1518
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.14502
Y Coord:	43.04722
Latitude:	43.04722
Longitude:	-76.14502

AL146 **500 WARREN ST** **UST FINDER RELEASE** **1029067783**
NW **500 WARREN ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.464 mi.
2451 ft. **Site 1 of 2 in cluster AL**

Relative: **Lower**
Actual: **392 ft.**

UST FINDER RELEASE:

Object ID:	249456
Facility ID:	NY239034
Lust ID:	NY9810139
Name:	500 WARREN ST
Address:	500 WARREN ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1998/11/11 15:59:59+00
Status:	No Further Action

500 WARREN ST (Continued) **1029067783**

Substance:	Not reported
Population within 1500ft:	1575
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.1509
Y Coord:	43.0454300000001
Latitude:	43.04543
Longitude:	-76.1508999999999

AL147 **HOTEL SYRACUSE** **RCRA-VSQG** **1000117279**
NW **500 S WARREN ST** **NY LTANKS** **NYD085169555**
1/4-1/2 **SYRACUSE, NY 13202** **US AIRS**
0.464 mi. **NY MANIFEST**
2451 ft. **Site 2 of 2 in cluster AL**

Relative: **Lower**
Actual: **392 ft.**

RCRA Listings:

Date Form Received by Agency:	20070101
Handler Name:	Hotel Syracuse
Handler Address:	S Warren St
Handler City,State,Zip:	SYRACUSE, NY 13202
EPA ID:	NYD085169555
Contact Name:	JIM FOOKS
Contact Address:	S WARREN ST
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	315-422-5121
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	Ny
State District:	NYSDEC R7
Mailing Address:	S WARREN ST
Mailing City,State,Zip:	SYRACUSE, NY 13202

HOTEL SYRACUSE (Continued) **1000117279**

Owner Name:	Allegro Corp	
Owner Type:		Private
Operator Name:	Allegro Corp	
Operator Type:		Private
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
202 GPRA Corrective Action Baseline:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No
Addressed Significant Non-Complier Universe:		No
Significant Non-Complier With a Compliance Schedule Universe:		No
Financial Assurance Required:		Not reported
Handler Date of Last Change:		20150414
Recognized Trader-Importer:		No
Recognized Trader-Exporter:		No
Importer of Spent Lead Acid Batteries:		No
Exporter of Spent Lead Acid Batteries:		No
Recycler Activity Without Storage:		No
Manifest Broker:		No
Sub-Part P Indicator:		No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	Ignitable Waste
Waste Code:	D008
Waste Description:	Lead
Waste Code:	D018
Waste Description:	Benzene
Waste Code:	D025

HOTEL SYRACUSE (Continued) **1000117279**

Waste Description: P-Cresol

Waste Code: D039
Waste Description: Tetrachloroethylene

Waste Code: D040
Waste Description: Trichloroethylene

Waste Code: F003
Waste Description: The Following Spent Nonhalogenated Solvents: Xylene, Acetone, Ethyl Acetate, Ethyl Benzene, Ethyl Ether, Methyl Isobutyl Ketone, N-Butyl Alcohol, Cyclohexanone, And Methanol; All Spent Solvent Mixtures/Blends Containing, Before Use, Only The Above Spent Nonhalogenated Solvents; And All Spent Solvent Mixtures/Blends Containing, Before Use, One Or More Of The Above Nonhalogenated Solvents, And A Total Of Ten Percent Or More (By Volume) Of One Or More Of Those Solvents Listed In F001, F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.

Waste Code: F005
Waste Description: The Following Spent Nonhalogenated Solvents: Toluene, Methyl Ethyl Ketone, Carbon Disulfide, Isobutanol, Pyridine, Benzene, 2-Ethoxyethanol, And 2-Nitropropane; All Spent Solvent Mixtures/Blends Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Nonhalogenated Solvents Or Those Solvents Listed In F001, F002, Or F004; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.

Waste Code: X001
Waste Description: Not Defined

Handler - Owner Operator:
Owner/Operator Indicator: Operator
Owner/Operator Name: ALLEGRO CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 500 S WARREN ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-422-5121
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: ALLEGRO CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 500 S WARREN ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-422-5121
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

HOTEL SYRACUSE (Continued) **1000117279**

Owner/Operator Indicator: Owner
Owner/Operator Name: ALLEGRO CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 500 S WARREN ST
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-422-5121
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20060101
Handler Name: HOTEL SYRACUSE
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: HOTEL SYRACUSE
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20000614
Handler Name: HOTEL SYRACUSE
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Ny
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

HOTEL SYRACUSE (Continued) **1000117279**

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

LTANKS:

Name:	500 WARREN ST
Address:	500 WARREN ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9810139 / 2000-04-24
Facility ID:	9810139
Site ID:	295387
Spill Date:	1998-11-11
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	1999-04-01
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1998-11-11
CID:	257
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	True
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1998-11-11
Spill Record Last Update:	2000-04-25
Spiller Name:	PATRICIA FOSDICK
Spiller Company:	PATRICIA FOSDICK
Spiller Address:	11527 MEASHERWELL
Spiller County:	001
Spiller Contact:	LT CAVUTO
Spiller Phone:	(315) 473-5671
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	239034
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	removed 9 gals of fuel from a leaking tuel tank ans fuel to be deposited in recovery drum

US AIRS (AFS):

Region Code:	02
County Code:	NY067
Programmatic ID:	AIR NY0000007311500076
Facility Registry ID:	110001578926
D and B Number:	Not reported
Facility Site Name:	Hotel Syracuse

HOTEL SYRACUSE (Continued) **1000117279**

Primary SIC Code: 7011
NAICS Code: 999999
Default Air Classification Code: SMI
Facility Type of Ownership Code: POF
Air CMS Category Code: Not reported
HPV Status: Not reported

US AIRS (AFS):
Region Code: 02
Programmatic ID: AIR NY0000007311500076
Facility Registry ID: 110001578926
Air Operating Status Code: OPR
Default Air Classification Code: SMI

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1990-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1989-03-03 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1987-12-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1987-01-14 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1985-12-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1985-03-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1983-12-08 00:00:00

HOTEL SYRACUSE (Continued) **1000117279**

Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1982-01-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

NY MANIFEST:
EPA ID: NYD085169555
Country: USA
Name: Hotel Syracuse
Address: 500 S WARREN ST
Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13202
Zip 4: Not reported
Location Address 1: 500 SOUTH WARREN ST
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13202
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: Hotel Syracuse
Mailing Contact: Denise Van Marter
Mailing Address 1: 500 SOUTH WARREN ST
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154225121

Manifest Data:
Document ID: ILA9015058
Manifest Status: Not reported
Trans1 State ID: UPW151288
Year: 2000
Trans2 State ID: UPW203954
Generator Ship Date: 07/31/2000
Trans1 Recv Date: 07/31/2000
Trans2 Recv Date: 08/03/2000
TSD Site Recv Date: 08/08/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD085169555
Trans1 EPA ID: SCR000075150
Trans2 EPA ID: SCR000074591
TSDF ID 1: ILD980613913
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported

HOTEL SYRACUSE (Continued) **1000117279**

Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code 1:	The Following Spent Nonhalogenated Solvents: Toluene, Methyl Ethyl Ketone, Carbon Disulfide, Isobutanol, Pyridine, Benzene, 2-Ethoxyethanol, And 2-Nitropropane; All Spent Solvent Mixtures/Blends Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Nonhalogenated Solvents Or Those Solvents Listed In F001, F002, Or F004; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00892
Units:	Pounds
Number of Containers:	003
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

Document ID:	NYC7164977
Manifest Status:	Not reported
Trans1 State ID:	NY18096JB
Year:	2003
Trans2 State ID:	1218B7NY
Generator Ship Date:	12/12/2003
Trans1 Recv Date:	12/12/2003
Trans2 Recv Date:	12/16/2003
TSD Site Recv Date:	12/18/2003
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD085169555
Trans1 EPA ID:	TXR000050930
Trans2 EPA ID:	NYD980769947
TSDF ID 1:	KYD053348108
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported

HOTEL SYRACUSE (Continued) **1000117279**

MGMT Method Type Code:	Not reported
Waste Code 1:	Ignitable Waste
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	00500
Units:	Pounds
Number of Containers:	002
Container Type:	Metal drums, barrels, kegs
Handling Method:	Burn
Specific Gravity:	01.00

EPA ID:	NYD981133390
Country:	USA
Name:	Hotels At Syracuse Square The
Address:	500 S WARREN ST
Address 2:	Not reported
City,State,Zip:	SYRACUSE, NY 13202
Zip 4:	Not reported
Location Address 1:	500 S WARREN ST
Location Address 2:	Not reported
Location City,State,Zip:	SYRACUSE, NY 13202
Location Zip 4:	Not reported
Facility Status:	Not reported
Total Tanks:	Not reported
Code:	BP

Mailing:

Mailing Name:	Hotels At Syracuse Square The
Mailing Contact:	Hotel Syracusw Restoration
Mailing Address 1:	500 S WARREN ST
Mailing Address 2:	Not reported
Mailing City,State,Zip:	SYRACUSE, NY 13202
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3153916326

Manifest Data:

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	10/30/2015
Trans1 Recv Date:	10/30/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/06/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported

HOTEL SYRACUSE (Continued) **1000117279**

Manifest Tracking Number:	004946142FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Ignitable Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	20
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	10/30/2015
Trans1 Recv Date:	10/30/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/06/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946143FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported

HOTEL SYRACUSE (Continued) **1000117279**

Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Mercury
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	15
Units:	Pounds
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	10/30/2015
Trans1 Recv Date:	10/30/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/06/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946143FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Lead
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported

HOTEL SYRACUSE (Continued) **1000117279**

Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	120
Units:	Gallons (liquids only)
Number of Containers:	4
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	10/30/2015
Trans1 Recv Date:	10/30/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/06/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946143FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Ignitable Waste
Waste Code b:	The Following Spent Nonhalogenated Solvents: Toluene, Methyl Ethyl Ketone, Carbon Disulfide, Isobutanol, Pyridine, Benzene, 2-Ethoxyethanol, And 2-Nitropropane; All Spent Solvent Mixtures/Blends Containing, Before Use, A Total Of Ten Percent Or More (By Volume) Of One Or More Of The Above Nonhalogenated Solvents Or Those Solvents Listed In F001, F002, Or F004; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent Mixtures.
Waste Code c:	Not reported
Waste Code e:	The Following Spent Nonhalogenated Solvents: Xylene, Acetone, Ethyl Acetate, Ethyl Benzene, Ethyl Ether, Methyl Isobutyl Ketone, N-Butyl Alcohol, Cyclohexanone, And Methanol; All Spent Solvent Mixtures/Blends Containing, Before Use, Only The Above Spent Nonhalogenated Solvents; And All Spent Solvent Mixtures/Blends Containing, Before Use, One Or More Of The Above Nonhalogenated Solvents, And A Total Of Ten Percent Or More (By Volume) Of One Or More Of Those Solvents Listed In F001, F002, F004, And F005; And Still Bottoms From The Recovery Of These Spent Solvents And Spent Solvent

HOTEL SYRACUSE (Continued) **1000117279**

	Mixtures.
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	12
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	10/30/2015
Trans1 Recv Date:	10/30/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/06/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946143FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Corrosive Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	30

HOTEL SYRACUSE (Continued) **1000117279**

Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiberboard or plastic drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	NYD013277454
Generator Ship Date:	08/17/2015
Trans1 Recv Date:	08/17/2015
Trans2 Recv Date:	08/18/2015
TSD Site Recv Date:	08/18/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	008231919FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Methane, Trichlorofluoro- (Or) Trichloromonofluoromethane
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	60
Units:	Gallons (liquids only)
Number of Containers:	2
Container Type:	Metal drums, barrels, kegs
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018

HOTEL SYRACUSE (Continued) **1000117279**

Trans2 State ID:	Not reported
Generator Ship Date:	09/01/2015
Trans1 Recv Date:	09/01/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/10/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	001161978GBF
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Corrosive Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	200
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	09/01/2015
Trans1 Recv Date:	09/01/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/10/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported

HOTEL SYRACUSE (Continued) **1000117279**

TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946151FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Corrosive Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	60
Units:	Pounds
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	09/01/2015
Trans1 Recv Date:	09/01/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/10/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946151FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N

HOTEL SYRACUSE (Continued) **1000117279**

Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Corrosive Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	30
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	09/01/2015
Trans1 Recv Date:	09/01/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/10/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946151FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Corrosive Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported

HOTEL SYRACUSE (Continued) **1000117279**

Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	50
Units:	Gallons (liquids only)
Number of Containers:	1
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1
Document ID:	Not reported
Manifest Status:	Not reported
Trans1 State ID:	NYD986980753
Year:	2018
Trans2 State ID:	Not reported
Generator Ship Date:	09/01/2015
Trans1 Recv Date:	09/01/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/10/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981133390
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD067098822
TSDF ID 2:	Not reported
Manifest Tracking Number:	004946152FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code a:	Corrosive Waste
Waste Code b:	Not reported
Waste Code c:	Not reported
Waste Code e:	Not reported
Waste Code f:	Not reported
Waste Code g:	Not reported
Waste Code 1:	Not reported
Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	50
Units:	Gallons (liquids only)
Number of Containers:	3
Container Type:	Fiber or plastic boxes, cartons, cases

HOTEL SYRACUSE (Continued) **1000117279**

Handling Method: Landfill
Specific Gravity: 1

Click this hyperlink while viewing on your computer to access
13 additional NY MANIFEST: record(s) in the EDR Site Report.

AM148 **H.S.M.PACKAGING CORP** **NY LTANKS** **S102234009**
West **123 LARNED ST** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.476 mi.
2514 ft. **Site 1 of 2 in cluster AM**

Relative: LTANKS:
Lower

Actual:
390 ft.

Name:	H.S.M.PACKAGING CORP
Address:	123 LARNED ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9605294 / 1996-09-30
Facility ID:	9605294
Site ID:	228231
Spill Date:	1996-07-24
Spill Cause:	Tank Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported
Reported to Dept:	1996-07-24
CID:	199
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1996-07-24
Spill Record Last Update:	1996-11-15
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	BOB DAVEY
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	188268
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM
Remarks:	working on const site a tank was found underground - tank is believed to be a 3000 gal tank - there is residue of contamination around the tank in the soil - tank will be pumped out tonight and tank dug out tomarrow - caller states tom mclaughlin from the region office was notified

All Materials:

H.S.M.PACKAGING CORP (Continued) **S102234009**

Site ID:	228231
Operable Unit ID:	1036177
Operable Unit:	01
Material ID:	348043
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

AM149 **H.S.M.PACKAGING CORP** **UST FINDER RELEASE** **1029063640**
West **123 LARNED ST** **N/A**
1/4-1/2 **SYRACUSE, NY 0**
0.476 mi.
2514 ft. **Site 2 of 2 in cluster AM**

Relative: **Lower**

Actual: **390 ft.**

UST FINDER RELEASE:

Object ID:	249439
Facility ID:	NY188268
Lust ID:	NY9605294
Name:	H.S.M.PACKAGING CORP
Address:	123 LARNED ST
City,State,Zip:	SYRACUSE, NY 0
Address Match Type:	Not reported
Reported Date:	1996/07/24 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	849
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	Yes
Tribe:	Not reported
EPA Region:	2
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	State
X Coord:	-76.15377
Y Coord:	43.04089
Latitude:	43.0408899999999
Longitude:	-76.1537699999999

AH150 **1400-20 SALINA STREET SOUTH** **US BROWNFIELDS** **1027142012**
SSW **1400-20 SALINA STREET SOUTH** **FINDS** **N/A**
1/4-1/2 **SYRACUSE, NY 13205**
0.477 mi.
2519 ft. **Site 2 of 2 in cluster AH**

Relative: **Lower**

Actual: **401 ft.**

US BROWNFIELDS:

Name:	1400-20 Salina Street South
Address:	1400-20 Salina Street South
City,State,Zip:	SYRACUSE, NY 13205
Property ID:	244991
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	085.-13-14.0
Parcel Size:	0.65
Latitude:	43.032959779
Longitude:	-76.148897602
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported

1400-20 SALINA STREET SOUTH (Continued) **1027142012**

Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.65
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported

1400-20 SALINA STREET SOUTH (Continued) **1027142012**

Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2623
Below Poverty Percent:	48.98
Meidan Income:	2521
Meidan Income Number:	3969
Meidan Income Percent:	74.12
Vacant Housing Number:	435
Vacant Housing Percent:	21.17
Unemployed Number:	281
Unemployed Percent:	5.25

Name:	1400-20 Salina Street South
Address:	1400-20 Salina Street South
City,State,Zip:	SYRACUSE, NY 13205
Property ID:	244991
Property Alias:	Not reported
Recipient Name:	Greater Syracuse Property Development Corporation
Grant Type:	Hazardous
Property Number:	085.-13-14.0
Parcel Size:	0.65
Latitude:	43.032959779
Longitude:	-76.148897602
Census Tract:	36067005300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	96255719
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	N
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported

1400-20 SALINA STREET SOUTH (Continued) **1027142012**

Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	0.65
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported

1400-20 SALINA STREET SOUTH (Continued) **1027142012**

Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2623
Below Poverty Percent:	48.98
Meidan Income:	2521
Meidan Income Number:	3969
Meidan Income Percent:	74.12
Vacant Housing Number:	435
Vacant Housing Percent:	21.17
Unemployed Number:	281
Unemployed Percent:	5.25

FINDS:
Registry ID: 110071198606

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

AK151 **PRESIDENTIAL PLAZA** **NY LTANKS** **S102678249**
North **PRESIDENTIAL PLAZA** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.481 mi.
2541 ft. **Site 3 of 3 in cluster AK**

Relative:
Lower

Actual:
400 ft.

LTANKS:

Name:	PRESIDENTIAL PLAZA
Address:	PRESIDENTIAL PLAZA
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9407228 / 2002-08-06
Facility ID:	9407228
Site ID:	250694
Spill Date:	1994-07-08
Spill Cause:	Tank Overfill
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	D5
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	CFMANNES
Referred To:	Not reported

PRESIDENTIAL PLAZA (Continued) **S102678249**

Reported to Dept:	1994-07-08
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1994-10-31
Spill Record Last Update:	2002-08-06
Spiller Name:	Not reported
Spiller Company:	JOHN FRANTZ
Spiller Address:	50 PRESUDENTIAL PLAZA
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	205504
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was CM 08/26/94: REPORT SUBMITTED. MINIMAL CONTAMINATION. 09/28/95: This is additional information about material spilled from the translation of the old spill file: TANK REMOVAL.
Remarks:	TANK(S) REMOVAL, ABANDEND TANK REAL REALESTATE TRANSACTION

All Materials:

Site ID:	250694
Operable Unit ID:	1001476
Operable Unit:	01
Material ID:	380242
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

---

152 **SPILL NUMBER 8601051** **NY LTANKS** **S104619126**
NE **CEDAR ST** **N/A**
1/4-1/2 **SYRACUSE, NY**
0.485 mi.
2560 ft.

Relative:
Higher

Actual:
408 ft.

LTANKS:

Name:	SPILL NUMBER 8601051
Address:	CEDAR ST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	8601051 / 1988-01-15
Facility ID:	8601051
Site ID:	278500
Spill Date:	1986-05-14

SPILL NUMBER 8601051 (Continued) **S104619126**

Spill Cause:	Tank Overfill
Spill Source:	Tank Truck
Spill Class:	Not reported
Cleanup Ceased:	1988-01-15
SWIS:	3415
Investigator:	UNASSIGNED
Referred To:	Not reported
Reported to Dept:	1986-05-14
CID:	Not reported
Water Affected:	ONONDAGA CREEK TRIB.
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1986-07-01
Spill Record Last Update:	1988-01-15
Spiller Name:	Not reported
Spiller Company:	SEARS OIL
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	226133
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was UK
Remarks:	OTH.SPILL LOC-@HUTCHINGS PSYCIATRIC INSTITUTE-F.D. WASHED TO STORM SEWER-SPILLER TO SPREAD SORBENT MATERIAL

All Materials:

Site ID:	278500
Operable Unit ID:	897325
Operable Unit:	01
Material ID:	477597
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	.00
Resource Affected:	Sewer
Oxygenate:	Not reported

153
NNW
1/4-1/2
0.488 mi.
2574 ft.

NYS ARMORY JEFFERSON ST.
JEFFERSON ST. ARMORY
SYRACUSE, NY

NY LTANKS **S100177734**
N/A

Relative:
Lower

Actual:
397 ft.

LTANKS:

Name:	NYS ARMORY JEFFERSON ST.
Address:	JEFFERSON ST. ARMORY
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9110102 / 1992-01-08
Facility ID:	9110102
Site ID:	114453
Spill Date:	1991-12-19
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Not reported
Cleanup Ceased:	1992-01-08
SWIS:	3415
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1991-12-19
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1991-12-26
Spill Record Last Update:	1995-01-03
Spiller Name:	Not reported
Spiller Company:	ARMORY/DIV. OF MIT. & NAV
Spiller Address:	330 OLD NISKAYUNA RD.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	99816
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR
Remarks:	01/08/92: 3 TANKS PULLED, 2 WEST TANKS-1 OF THE THEM HAD SEVERAL PINHOLES,1 LARGE HOLE .25 DIA,DUG OUT CONTAMINATED SOIL,CONCRETE PAD STOPPED ANY FURTHER CONTAMINATION APPROX. 20YDS3 DIESEL TANK OKAY. CONTACT MICHAEL CANONICA NG FACILITY ENG. OFFICER.- TANK TEST FAILURE 2-1500 GALLON GAS, 1-2000 GALLON GAS.

All Materials:

Site ID:	114453
Operable Unit ID:	960113
Operable Unit:	01
Material ID:	418673
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00

NYS ARMORY JEFFERSON ST. (Continued) **S100177734**

Units:	Not reported
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

154
ENE
1/4-1/2
0.498 mi.
2627 ft.

SYRACUSE UNIVERSITY
700 UNIVERSITY AVENUE
SYRACUSE, NY

NY LTANKS **S102660364**
N/A

Relative:
Higher

Actual:
494 ft.

LTANKS:

Name:	SYRACUSE UNIVERSITY
Address:	700 UNIVERSITY AVENUE
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	9706956 / 1997-12-12
Facility ID:	9706956
Site ID:	100091
Spill Date:	1997-09-11
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	3415
Investigator:	ROMOCKI
Referred To:	Not reported
Reported to Dept:	1997-09-11
CID:	205
Water Affected:	Not reported
Spill Notifier:	Affected Persons
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1997-09-11
Spill Record Last Update:	1997-09-11
Spiller Name:	PAT STOCK
Spiller Company:	SYRACUSE UNIVERSITY
Spiller Address:	029 LYMAN HALL
Spiller County:	001
Spiller Contact:	CALLER
Spiller Phone:	(315) 443-4132
Spiller Extention:	Not reported
DEC Region:	7
DER Facility ID:	88912
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was MR 09/11/97: INSPECTED SITE WITH PAT STOCK OF S.U. CONTAMINATED SOIL BEING STAGED ON SITE. TO BE DISPOSED OF. CONFIRMATION SAMPLES TO BE COLLECTED FROM EXCAVATION AFTER REMOVING CONTAMINATED SOIL. EXPECT TO HAVE SOME RESIDUAL CONTAMINATION,DUE TO RESTICTIONS OF UNDERGROUND UTILITIES WHILE DIGGING. TANK CLOSURE REPORT TO BE SUBMITTED. 12/12/97: REC'D CLOSURE REPORT. CLEANUP COMPLETE.
Remarks:	CALLER HAVING OLD TANK REMOVED AND FOUND CONTAMINATED SOIL.

155
SW
1/2-1
0.758 mi.
4000 ft.

BROWN MANUFACTURING SITE FORMER
101 CHESTER ST
SYRACUSE, NY 13207

NY SHWS **S105859104**
NY ENG CONTROLS **N/A**
NY INST CONTROL
NY ERP
NY MANIFEST

Relative:
Lower

Actual:
390 ft.

SHWS:

Name:	FORMER BROWN MANUFACTURING SITE
Address:	101 CHESTER STREET
City,State,Zip:	SYRACUSE, NY 13207
Program:	HW
Site Code:	465076
Classification:	C
Region:	7
Acres:	0.800
HW Code:	734141
Record Add:	06/07/2012
Record Upd:	01/07/2021
Updated By:	JPCOOK
Site Description:	"See Site # B00024."
Env Problem:	"See Site # B00024."
Health Problem:	Not reported
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2012-06-11 10:46:00
Record Upd:	2016-06-15 11:38:00
Updated By:	JPCOOK
Own Op:	1
Sub Type:	C01
Owner Name:	Owen Kerney
Owner Company:	City of Syracuse TD
Owner Address:	201 E. Washington St, Suite 5000
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	734141
Waste Type:	CHROMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	BENZO(B)FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	BARIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	SELENIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Waste Type:	Chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	DIBENZ[A,H]ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	LEAD
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	indeno(1,2,3-cd)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	ARSENIC
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	BENZ(A)ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	BENZO(A)PYRENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	CADMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	COPPER
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	NICKEL
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	BENZO[K]FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	Petroleum Products
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734141
Waste Type:	benzo(a)anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	Not reported
Cross Ref Type Code:	Not reported

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Cross Ref Type: Not reported
Record Added Date: Not reported
Record Updated: Not reported
Updated By: Not reported

ENG CONTROLS:
Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
HW Code: B00024
Control Code: 15
Control Type: ENG
Date Record Added: 06/11/2012
Date Rec Updated: 10/27/2022
Updated By: GWPRISCO
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."
Env Problem: "Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

	below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."
Health Problem:	"Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
	Not reported
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	43:02:00. / 76:09:28.
Dell:	False
Record Add:	2003-10-28 13:52:00
Record Upd:	2012-10-04 14:34:00
Updated By:	ldennist
Own Op:	1
Sub Type:	C01
Owner Name:	Not reported
Owner Company:	City of Syracuse
Owner Address:	203 City Hall, 233 E Washington St
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	6
Sub Type:	C01
Owner Name:	Ben Walsh
Owner Company:	City of Syracuse
Owner Address:	203 City Hall
Owner Addr2:	233 E Washington Street
Owner City,St,Zip:	SYRACUSE (C), NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Local History & Genealogy Department
Owner Company:	Onondaga County Public Library
Owner Address:	The Galleries of Syracuse
Owner Addr2:	447 South Salina Street
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Joshua Cook
Owner Company:	NYSDEC Region 7
Owner Address:	615 Erie Blvd West
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13204
Owner Country:	United States of America
HW Code:	B00024
Waste Type:	Petroleum Products
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	benzo(k)fluoranthene
Waste Quantity:	UNKNOWN

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Waste Code:	Not reported
HW Code:	B00024
Waste Type:	PHENANTHRENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	PYRENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	SELENIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	BENZ(A)ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	BENZO(B)FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	Chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	ARSENIC
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	CADMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	DIBENZ[A,H]ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	LEAD
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	NICKEL
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	NAPHTHALENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

HW Code:	B00024
Waste Type:	BENZO[K]FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	BENZO(A)PYRENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	COPPER
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	BARIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	CHROMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	indeno(1,2,3-cd)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	B00024
Waste Type:	BENZO(A)ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	NYR000223016
Cross Ref Type Code:	06
Cross Ref Type:	RCRA EPA ID No.
Record Added Date:	2015-11-13 13:18:00
Record Updated:	2015-11-13 13:18:00
Updated By:	JPCOOK
Crossref ID:	7-601599
Cross Ref Type Code:	18
Cross Ref Type:	PBS No.
Record Added Date:	2017-01-03 13:17:00
Record Updated:	2017-01-03 13:17:00
Updated By:	JPCOOK
Crossref ID:	NYWII-B00024-12-14
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2018-03-06 11:54:00
Record Updated:	2018-03-06 11:54:00
Updated By:	JPCOOK
Crossref ID:	C300654
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2018-03-06 11:55:00
Record Updated:	2018-03-06 11:55:00
Updated By:	JPCOOK
Crossref ID:	B 5431 P 745
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2017-07-28 13:09:00
Record Updated:	2017-07-28 13:09:00

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Updated By: JPCOOK

INST CONTROL:
Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Control Name: Monitoring Plan
HW Code: B00024
Control Code: 31
Control Type: INST
Dt record added: 06/11/2012
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57206
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."
Env Problem: "Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

a Site Management Plan. Groundwater contamination was not identified by the investigation."
Health Problem: "Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
Not reported
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 43:02:00. / 76:09:28.
Dell: False
Record Add: 2003-10-28 13:52:00
Record Upd: 2012-10-04 14:34:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: Not reported
Owner Company: City of Syracuse
Owner Address: 203 City Hall, 233 E Washington St
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Ben Walsh
Owner Company: City of Syracuse
Owner Address: 203 City Hall
Owner Addr2: 233 E Washington Street
Owner City,St,Zip: SYRACUSE (C), NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Local History & Genealogy Department
Owner Company: Onondaga County Public Library
Owner Address: The Galleries of Syracuse
Owner Addr2: 447 South Salina Street
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Joshua Cook
Owner Company: NYSDEC Region 7
Owner Address: 615 Erie Blvd West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13204
Owner Country: United States of America
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

HW Code: B00024
Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00
Updated By: JPCOOK
Crossref ID: C300654
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00
Updated By: JPCOOK
Crossref ID: B 5431 P 745
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Control Name: IC/EC Plan
HW Code: B00024
Control Code: 34
Control Type: INST
Dt record added: 06/11/2012
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57206
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."
Env Problem: "Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."
Health Problem: "Measures are in place to control the potential for coming into

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

contact with remaining subsurface soil and groundwater contamination."
Not reported
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 43:02:00. / 76:09:28.
Dell: False
Record Add: 2003-10-28 13:52:00
Record Upd: 2012-10-04 14:34:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: Not reported
Owner Company: City of Syracuse
Owner Address: 203 City Hall, 233 E Washington St
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Ben Walsh
Owner Company: City of Syracuse
Owner Address: 203 City Hall
Owner Addr2: 233 E Washington Street
Owner City,St,Zip: SYRACUSE (C), NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Local History & Genealogy Department
Owner Company: Onondaga County Public Library
Owner Address: The Galleries of Syracuse
Owner Addr2: 447 South Salina Street
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Joshua Cook
Owner Company: NYSDEC Region 7
Owner Address: 615 Erie Blvd West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13204
Owner Country: United States of America
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Waste Code: Not reported
HW Code: B00024
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

HW Code: B00024
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00
Updated By: JPCOOK
Crossref ID: C300654
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00
Updated By: JPCOOK
Crossref ID: B 5431 P 745
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Control Name: Site Management Plan
HW Code: B00024
Control Code: 32
Control Type: INST
Dt record added: 06/11/2012
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57206
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."
Env Problem: "Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."
Health Problem: "Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
Not reported

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 43:02:00. / 76:09:28.
Dell: False
Record Add: 2003-10-28 13:52:00
Record Upd: 2012-10-04 14:34:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: Not reported
Owner Company: City of Syracuse
Owner Address: 203 City Hall, 233 E Washington St
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Ben Walsh
Owner Company: City of Syracuse
Owner Address: 203 City Hall
Owner Addr2: 233 E Washington Street
Owner City,St,Zip: SYRACUSE (C), NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Local History & Genealogy Department
Owner Company: Onondaga County Public Library
Owner Address: The Galleries of Syracuse
Owner Addr2: 447 South Salina Street
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Joshua Cook
Owner Company: NYSDEC Region 7
Owner Address: 615 Erie Blvd West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13204
Owner Country: United States of America
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)PYRENE

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00
Updated By: JPCOOK
Crossref ID: C300654
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00
Updated By: JPCOOK
Crossref ID: B 5431 P 745
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Control Name: Soil Management Plan
HW Code: B00024
Control Code: 14
Control Type: INST
Dt record added: 06/11/2012
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57206
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."
Env Problem: "Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."
Health Problem: "Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
Not reported
Dump: False
Structure: False

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 43:02:00. / 76:09:28.
Dell: False
Record Add: 2003-10-28 13:52:00
Record Upd: 2012-10-04 14:34:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: Not reported
Owner Company: City of Syracuse
Owner Address: 203 City Hall, 233 E Washington St
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Ben Walsh
Owner Company: City of Syracuse
Owner Address: 203 City Hall
Owner Addr2: 233 E Washington Street
Owner City,St,Zip: SYRACUSE (C), NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Local History & Genealogy Department
Owner Company: Onondaga County Public Library
Owner Address: The Galleries of Syracuse
Owner Addr2: 447 South Salina Street
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Joshua Cook
Owner Company: NYSDEC Region 7
Owner Address: 615 Erie Blvd West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13204
Owner Country: United States of America
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Waste Code: Not reported
HW Code: B00024
Waste Type: PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

HW Code: B00024
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00
Updated By: JPCOOK
Crossref ID: C300654
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00
Updated By: JPCOOK
Crossref ID: B 5431 P 745
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Control Name: Environmental Easement
HW Code: B00024

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Control Code: J
Control Type: INST
Dt record added: 06/11/2012
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57206
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."
Env Problem: "Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."
Health Problem: "Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
Not reported
Dump: False
Structure: False
Lagoon: False
Landfill: False

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 43:02:00. / 76:09:28.
Dell: False
Record Add: 2003-10-28 13:52:00
Record Upd: 2012-10-04 14:34:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: Not reported
Owner Company: City of Syracuse
Owner Address: 203 City Hall, 233 E Washington St
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Ben Walsh
Owner Company: City of Syracuse
Owner Address: 203 City Hall
Owner Addr2: 233 E Washington Street
Owner City,St,Zip: SYRACUSE (C), NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Local History & Genealogy Department
Owner Company: Onondaga County Public Library
Owner Address: The Galleries of Syracuse
Owner Addr2: 447 South Salina Street
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Joshua Cook
Owner Company: NYSDEC Region 7
Owner Address: 615 Erie Blvd West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13204
Owner Country: United States of America
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Waste Type: PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: COPPER

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00
Updated By: JPCOOK
Crossref ID: C300654
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00
Updated By: JPCOOK
Crossref ID: B 5431 P 745
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Control Name: Ground Water Use Restriction
HW Code: B00024
Control Code: 08
Control Type: INST

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Dt record added: 06/11/2012
Dt rec updated: 10/27/2022
Updated By: GWPRISCO
Site Code: 57206
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."
Env Problem: "Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."
Health Problem: "Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
Not reported
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Disp Term: Not reported
Lat/Long: 43:02:00. / 76:09:28.
Dell: False
Record Add: 2003-10-28 13:52:00
Record Upd: 2012-10-04 14:34:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: Not reported
Owner Company: City of Syracuse
Owner Address: 203 City Hall, 233 E Washington St
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Ben Walsh
Owner Company: City of Syracuse
Owner Address: 203 City Hall
Owner Addr2: 233 E Washington Street
Owner City,St,Zip: SYRACUSE (C), NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Local History & Genealogy Department
Owner Company: Onondaga County Public Library
Owner Address: The Galleries of Syracuse
Owner Addr2: 447 South Salina Street
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Joshua Cook
Owner Company: NYSDEC Region 7
Owner Address: 615 Erie Blvd West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13204
Owner Country: United States of America
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PYRENE
Waste Quantity: UNKNOWN

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Waste Code: Not reported
HW Code: B00024
Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

HW Code: B00024
Waste Type: BARIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00
Updated By: JPCOOK
Crossref ID: C300654
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00
Updated By: JPCOOK
Crossref ID: B 5431 P 745
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Control Name: Landuse Restriction
HW Code: B00024
Control Code: 25
Control Type: INST
Dt record added: 06/11/2012
Dt rec updated: 10/27/2022

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Updated By: GWPRISCO
Site Code: 57206
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."
Env Problem: "Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."
Health Problem: "Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
Not reported
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 43:02:00. / 76:09:28.

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Dell: False
Record Add: 2003-10-28 13:52:00
Record Upd: 2012-10-04 14:34:00
Updated By: ldennist
Own Op: 1
Sub Type: C01
Owner Name: Not reported
Owner Company: City of Syracuse
Owner Address: 203 City Hall, 233 E Washington St
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 6
Sub Type: C01
Owner Name: Ben Walsh
Owner Company: City of Syracuse
Owner Address: 203 City Hall
Owner Addr2: 233 E Washington Street
Owner City,St,Zip: SYRACUSE (C), NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Local History & Genealogy Department
Owner Company: Onondaga County Public Library
Owner Address: The Galleries of Syracuse
Owner Addr2: 447 South Salina Street
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Joshua Cook
Owner Company: NYSDEC Region 7
Owner Address: 615 Erie Blvd West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13204
Owner Country: United States of America
HW Code: B00024
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PHENANTHRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Waste Type: SELENIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: Chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: DIBENZ[A,H]ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: LEAD
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NICKEL
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO[K]FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: COPPER
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BARIUM

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: CHROMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: indeno(1,2,3-cd)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: B00024
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYR000223016
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2015-11-13 13:18:00
Record Updated: 2015-11-13 13:18:00
Updated By: JPCOOK
Crossref ID: 7-601599
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2017-01-03 13:17:00
Record Updated: 2017-01-03 13:17:00
Updated By: JPCOOK
Crossref ID: NYWII-B00024-12-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:54:00
Record Updated: 2018-03-06 11:54:00
Updated By: JPCOOK
Crossref ID: C300654
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2018-03-06 11:55:00
Record Updated: 2018-03-06 11:55:00
Updated By: JPCOOK
Crossref ID: B 5431 P 745
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-07-28 13:09:00
Record Updated: 2017-07-28 13:09:00
Updated By: JPCOOK

ERP:
Name: FORMER BROWN MANUFACTURING SITE
Address: 101 CHESTER STREET
City,State,Zip: SYRACUSE, NY 13207
Site Code: 57206
Program: ERP
HW Code: B00024
Site Class: C
Class N: C
SWIS: 3415
Region: 7
Town: Syracuse (c)

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Acres: 0.800
Record Added: 10/28/2003
Record Updated: 02/05/2024
Updated By: GWPRISCO
Site Description: "Location: The Former Brown Manufacturing site is located at 101 Chester Street in a residential portion of the City of Syracuse, Onondaga County. The site is located at the southeast corner of the intersection of Chester Street and Bellevue Avenue and is bordered to the north by Bellevue Avenue with residential properties and a community garden beyond, to the south by a residential property on Chester Street, to the east by residential properties along Huron Street, and to the west by Chester Street with a supermarket on the other side of Chester Street. Site Features: The site is vacant and is a generally flat parcel of land covered with grass. Current Zoning and Land Use: The site is currently vacant. Most of the surrounding parcels are residential parcels, several of which are also vacant. Past Use of the Site: The site was formerly the location of the Brown Manufacturing Corporation, an automobile parts manufacturing facility which burned down in August of 1981. Prior uses that appear to have led to site contamination include disposal of waste oil/sludge into a disposal pit and underground quenching trough. Following the fire, a remediation contractor reportedly removed and disposed of approximately 100 drums of PCB-contaminated waste oil, the contents of the disposal pit and quenching trough, and a ruptured electrical transformer. Site Geology and Hydrogeology: The investigation of the site identified two soil units. The top unit consists of fill generally ranging from 1 to 4 feet thick, but up to 8 to 12 feet thick in some areas. The fill is comprised of sand, crushed stone, concrete debris, brick, ash, cinders and wood debris. The fill was underlain by a dense silty layer that also contained some clay and fine sand which was approximately 6 to 8 feet thick. A sandy, gravelly layer was present across the site at approximately 10 to 12 feet below grade, and was underlain by more silt, clay and fine sand. The geology of the area generally consists of glaciolacustrine silt and clay, with alluvial sands and gravels present in some areas near Onondaga Creek. Those units are underlain by glacial till. Groundwater at the site was generally encountered around 9 to 11 feet below grade and flows south towards Onondaga Creek, which is located approximately 450 feet south of the site and flows generally southwest to northeast in this area."
Env Problem: "Nature and Extent of Contamination: Prior to remediation, the primary contaminants of concern at the site included polychlorinated biphenyls (PCBs), petroleum hydrocarbons, polycyclic aromatic hydrocarbons (PAHs), and metals in soil. The most-highly contaminated soils were removed during remediation. Contaminants remain in soil below a two-foot clean soil cover system, which will be managed under a Site Management Plan. Groundwater contamination was not identified by the investigation."
Health Problem: "Measures are in place to control the potential for coming into contact with remaining subsurface soil and groundwater contamination."
Not reported

NY MANIFEST:
EPA ID: NYR000223016
Country: USA
Name: Brown Manufacturing Site Former
Address: 101 CHESTER ST

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Address 2: Not reported
City,State,Zip: SYRACUSE, NY 13207
Zip 4: Not reported
Location Address 1: 101 CHESTER STREET
Location Address 2: Not reported
Location City,State,Zip: SYRACUSE, NY 13207
Location Zip 4: Not reported
Facility Status: Not reported
Total Tanks: Not reported
Code: BP

Mailing:
Mailing Name: Brown Manufacturing Site Former
Mailing Contact: Joshua Cook
Mailing Address 1: 201 E WASHINGTON ST
Mailing Address 2: Not reported
Mailing City,State,Zip: SYRACUSE, NY 13202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 3154267411

Manifest Data:
Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: MAD084814136
Year: 2018
Trans2 State ID: MIK435642742
Generator Ship Date: 11/01/2016
Trans1 Recv Date: 11/01/2016
Trans2 Recv Date: 11/02/2016
TSD Site Recv Date: 11/18/2016
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000223016
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: MID048090633
TSDF ID 2: Not reported
Manifest Tracking Number: 015187140JJK
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H141
Waste Code a: Not reported
Waste Code b: B007
Waste Code c: Not reported
Waste Code e: Not reported
Waste Code f: Not reported
Waste Code g: Not reported
Waste Code 1: Not reported

BROWN MANUFACTURING SITE FORMER (Continued) **S105859104**

Waste Code 2:	Not reported
Waste Code 3:	Not reported
Waste Code 4:	Not reported
Waste Code 5:	Not reported
Waste Code 6:	Not reported
Quantity:	2727
Units:	Kilograms
Number of Containers:	3
Container Type:	Fiber or plastic boxes, cartons, cases
Handling Method:	Landfill
Specific Gravity:	1

156
NW
1/2-1
0.902 mi.
4764 ft.

NIMO - SYRACUSE - ERIE MGP **EDR MGP** **1008408047**
300 ERIC BLVD WEST **N/A**
SYRACUSE, NY 13202

Relative: Lower

Actual: 400 ft.

EDR MGP:

No additional information available

157
NW
1/2-1
0.939 mi.
4958 ft.

NM - SYRACUSE ERIE BLVD. MGP **NY SHWS** **S111065346**
300 ERIE BLVD WEST **NY LTANKS** **N/A**
SYRACUSE, NY 13208 **NY ENG CONTROLS**
NY INST CONTROL
NY Spills
NY MGP

Relative: Lower

Actual: 400 ft.

SHWS:

Name:	NM - SYRACUSE ERIE BLVD. MGP
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13208-
Program:	HW
Site Code:	56354
Classification:	C
Region:	7
Acres:	8.190
HW Code:	734060
Record Add:	11/18/1999
Record Upd:	11/08/2024
Updated By:	AMOMOROG

Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

	1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem:	"Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem:	"Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	00:00:00:0 / 00:00:00:0
Dell:	False
Record Add:	1999-11-18 12:00:00
Record Upd:	2015-01-05 15:51:00
Updated By:	ALKARWIE
Own Op:	Document Repository
Sub Type:	C04
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	03
Owner Name:	Devin Shay
Owner Company:	Nat Grid
Owner Address:	300 Erie Blvd. West
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	734060
Waste Type:	COAL TAR
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	NAPHTHALENE

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

LTANKS:
Name: NIMOSYR
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 8710546 / 1988-05-20
Facility ID: 8710546
Site ID: 150027
Spill Date: 1988-03-17
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Not reported
Cleanup Ceased: 1988-05-20
SWIS: 3415
Investigator: AJMARSCH
Referred To: Not reported
Reported to Dept: 1988-03-17
CID: Not reported
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: True
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1988-03-31
Spill Record Last Update: 1988-06-02
Spiller Name: Not reported
Spiller Company: NIAGARA MOHAWK
Spiller Address: Not reported
Spiller County: 999
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 7
DER Facility ID: 327390
Latitude: Not reported

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Longitude:	Not reported
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was JM 04/07/88: TANK WAS RETESED ON 4/7/88 AFTER PIPING MODIFICATIONS WERE COMPLETED. TANK FAILED RETEST. NIMO HAD 2000 GAL TANK PUMPED OUT AND PUT REMOVAL UP FOR BID.ANTICIPATE 30 DAY LAG FOR REMOVAL. (CHRIS WHITE). 05/20/88: LINE WAS REPAIRED . TANK IS TIGHT. 09/28/95: This is additional information about material spilled from the translation of the old spill file: UNK QUANTITY.
Remarks:	2000 GAL TANK SYATEM FAILED PETROTITE 2.0 GPH____ CLEMENT.

All Materials:

Site ID:	150027
Operable Unit ID:	915453
Operable Unit:	01
Material ID:	462317
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Groundwater
Oxygenate:	Not reported

ENG CONTROLS:

Name:	NM - SYRACUSE ERIE BLVD. MGP
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13208-
Site Code:	56354
HW Code:	734060
Control Code:	36
Control Type:	ENG
Date Record Added:	12/20/2021
Date Rec Updated:	10/29/2024
Updated By:	MACOCHRA
Site Description:	"Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north.

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

	The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem:	"Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem:	"Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	00:00:00:0 / 00:00:00:0
Dell:	False
Record Add:	1999-11-18 12:00:00
Record Upd:	2015-01-05 15:51:00
Updated By:	ALKARWIE
Own Op:	Document Repository
Sub Type:	C04
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	03
Owner Name:	Devin Shay
Owner Company:	Nat Grid
Owner Address:	300 Erie Blvd. West
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	734060
Waste Type:	COAL TAR
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	NAPHTHALENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	2020-00007787
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2020-04-20 15:36:00
Record Updated:	2020-07-15 14:36:00
Updated By:	SMQUANDT

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Crossref ID:	2020-00007787
Cross Ref Type Code:	31
Cross Ref Type:	Environmental Easement No.
Record Added Date:	2020-04-20 15:36:00
Record Updated:	2020-04-20 15:36:00
Updated By:	JEBROWN
Crossref ID:	A4-0473-0000
Cross Ref Type Code:	26
Cross Ref Type:	Agreement/Consent Order Date
Record Added Date:	2018-01-12 09:16:00
Record Updated:	2018-01-12 09:18:00
Updated By:	JTSPELLM
Name:	NM - SYRACUSE ERIE BLVD. MGP
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13208-
Site Code:	56354
HW Code:	734060
Control Code:	15
Control Type:	ENG
Date Record Added:	03/08/2024
Date Rec Updated:	10/29/2024
Updated By:	MACOCHRA
Site Description:	"Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem:	"Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem:	"Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump:	False
Structure:	False
Lagoon:	False

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	00:00:00:0 / 00:00:00:0
Dell:	False
Record Add:	1999-11-18 12:00:00
Record Upd:	2015-01-05 15:51:00
Updated By:	ALKARWIE
Own Op:	Document Repository
Sub Type:	C04
Owner Name:	Not reported
Owner Company:	Onondaga County Public Library
Owner Address:	447 South Salina Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
Own Op:	1
Sub Type:	03
Owner Name:	Devin Shay
Owner Company:	Nat Grid
Owner Address:	300 Erie Blvd. West
Owner Addr2:	Not reported
Owner City,St,Zip:	Syracuse, NY 13202
Owner Country:	United States of America
HW Code:	734060
Waste Type:	COAL TAR
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	734060
Waste Type:	NAPHTHALENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	2020-00007787
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2020-04-20 15:36:00
Record Updated:	2020-07-15 14:36:00
Updated By:	SMQUANDT
Crossref ID:	2020-00007787
Cross Ref Type Code:	31
Cross Ref Type:	Environmental Easement No.
Record Added Date:	2020-04-20 15:36:00
Record Updated:	2020-04-20 15:36:00
Updated By:	JEBROWN
Crossref ID:	A4-0473-0000
Cross Ref Type Code:	26
Cross Ref Type:	Agreement/Consent Order Date
Record Added Date:	2018-01-12 09:16:00
Record Updated:	2018-01-12 09:18:00
Updated By:	JTSPELLM

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

INST CONTROL:

Name:	NM - SYRACUSE ERIE BLVD. MGP
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13208-
Site Code:	56354
Control Name:	Ground Water Use Restriction
HW Code:	734060
Control Code:	08
Control Type:	INST
Dt record added:	03/08/2024
Dt rec updated:	10/29/2024
Updated By:	MACOCHRA
Site Code:	56354
Site Description:	"Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem:	"Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem:	"Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	00:00:00:0 / 00:00:00:0
Dell:	False
Record Add:	1999-11-18 12:00:00
Record Upd:	2015-01-05 15:51:00
Updated By:	ALKARWIE
Own Op:	Document Repository

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Sub Type: C04
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03
Owner Name: Devin Shay
Owner Company: Nat Grid
Owner Address: 300 Erie Blvd. West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: 734060
Waste Type: COAL TAR
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

Name: NM - SYRACUSE ERIE BLVD. MGP
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY 13208-
Site Code: 56354
Control Name: Soil Management Plan
HW Code: 734060
Control Code: 14
Control Type: INST
Dt record added: 03/08/2024
Dt rec updated: 10/29/2024
Updated By: MACOCHRA

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Site Code: 56354
Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem: "Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 00:00:00:0 / 00:00:00:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 2015-01-05 15:51:00
Updated By: ALKARWIE
Own Op: Document Repository
Sub Type: C04
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03
Owner Name: Devin Shay
Owner Company: Nat Grid
Owner Address: 300 Erie Blvd. West

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: 734060
Waste Type: COAL TAR
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

Name: NM - SYRACUSE ERIE BLVD. MGP
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY 13208-
Site Code: 56354
Control Name: Landuse Restriction
HW Code: 734060
Control Code: 25
Control Type: INST
Dt record added: 03/08/2024
Dt rec updated: 10/29/2024
Updated By: MACOCHRA
Site Code: 56354
Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."

Health Problem: "Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 00:00:00:0 / 00:00:00:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 2015-01-05 15:51:00
Updated By: ALKARWIE
Own Op: Document Repository
Sub Type: C04
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03
Owner Name: Devin Shay
Owner Company: Nat Grid
Owner Address: 300 Erie Blvd. West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: 734060
Waste Type: COAL TAR
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

Name: NM - SYRACUSE ERIE BLVD. MGP
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY 13208-
Site Code: 56354
Control Name: IC/EC Plan
HW Code: 734060
Control Code: 34
Control Type: INST
Dt record added: 03/08/2024
Dt rec updated: 10/29/2024
Updated By: MACOCHRA
Site Code: 56354
Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

unsuitable for potable purposes. "
Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem: "Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 00:00:00:0 / 00:00:00:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 2015-01-05 15:51:00
Updated By: ALKARWIE
Own Op: Document Repository
Sub Type: C04
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03
Owner Name: Devin Shay
Owner Company: Nat Grid
Owner Address: 300 Erie Blvd. West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: 734060
Waste Type: COAL TAR
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

Name: NM - SYRACUSE ERIE BLVD. MGP
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY 13208-
Site Code: 56354
Control Name: Site Management Plan
HW Code: 734060
Control Code: 32
Control Type: INST
Dt record added: 03/08/2024
Dt rec updated: 10/29/2024
Updated By: MACOCHRA
Site Code: 56354
Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem: "Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump: False
Structure: False
Lagoon: False
Landfill: False

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 00:00:00:0 / 00:00:00:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 2015-01-05 15:51:00
Updated By: ALKARWIE
Own Op: Document Repository
Sub Type: C04
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03
Owner Name: Devin Shay
Owner Company: Nat Grid
Owner Address: 300 Erie Blvd. West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: 734060
Waste Type: COAL TAR
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

Name: NM - SYRACUSE ERIE BLVD. MGP
Address: 300 ERIE BLVD WEST

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

City,State,Zip: SYRACUSE, NY 13208-
Site Code: 56354
Control Name: Monitoring Plan
HW Code: 734060
Control Code: 31
Control Type: INST
Dt record added: 03/08/2024
Dt rec updated: 10/29/2024
Updated By: MACOCHRA
Site Code: 56354
Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "
Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem: "Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 00:00:00:0 / 00:00:00:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 2015-01-05 15:51:00
Updated By: ALKARWIE
Own Op: Document Repository
Sub Type: C04
Owner Name: Not reported
Owner Company: Onondaga County Public Library

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03
Owner Name: Devin Shay
Owner Company: Nat Grid
Owner Address: 300 Erie Blvd. West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
HW Code: 734060
Waste Type: COAL TAR
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

Name: NM - SYRACUSE ERIE BLVD. MGP
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY 13208-
Site Code: 56354
Control Name: Environmental Easement
HW Code: 734060
Control Code: J
Control Type: INST
Dt record added: 03/08/2024
Dt rec updated: 10/29/2024
Updated By: MACOCHRA
Site Code: 56354
Site Description: "Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan."

Health Problem: "Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: 00:00:00:0 / 00:00:00:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 2015-01-05 15:51:00
Updated By: ALKARWIE
Own Op: Document Repository
Sub Type: C04
Owner Name: Not reported
Owner Company: Onondaga County Public Library
Owner Address: 447 South Salina Street
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America
Own Op: 1
Sub Type: 03
Owner Name: Devin Shay
Owner Company: Nat Grid
Owner Address: 300 Erie Blvd. West
Owner Addr2: Not reported
Owner City,St,Zip: Syracuse, NY 13202
Owner Country: United States of America

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

HW Code: 734060
Waste Type: COAL TAR
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: benzene, toluene, ethylbenzene and xylenes (BTEX)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 734060
Waste Type: NAPHTHALENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: 2020-00007787
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-07-15 14:36:00
Updated By: SMQUANDT
Crossref ID: 2020-00007787
Cross Ref Type Code: 31
Cross Ref Type: Environmental Easement No.
Record Added Date: 2020-04-20 15:36:00
Record Updated: 2020-04-20 15:36:00
Updated By: JEBROWN
Crossref ID: A4-0473-0000
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2018-01-12 09:16:00
Record Updated: 2018-01-12 09:18:00
Updated By: JTSPELLM

SPILLS:

Name: NATIONAL GRID SYRACUSE OFFICE
Address: 300 ERIE BLVD WEST
City,State,Zip: SYRACUSE, NY
Spill Number/Closed Date: 1000219 / 2010-04-06
Facility ID: 1000219
Facility Type: ER
DER Facility ID: 327390
Site ID: 431380
DEC Region: 7
Spill Cause: Equipment Failure
Spill Class: E5
SWIS: 3415
Spill Date: 2010-04-05
Investigator: DJLASALL
Referred To: Not reported
Reported to Dept: 2010-04-06
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Not reported
UST Trust: False

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Remediation Phase:	0
Date Entered In Computer:	2010-04-06
Spill Record Last Update:	2010-04-08
Spiller Name:	BOB CAZZOLLI
Spiller Company:	NATIONAL GRID SYRACUSE OFFICE
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	999
Contact Name:	BOB CAZZOLLI
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Emailed spill report to Reggie Parker, Regional Air Engineer 4/6/10
Remarks:	valve leak; Cylinder emptied into another

All Materials:

Site ID:	431380
Operable Unit ID:	1182832
Operable Unit:	01
Material ID:	2177036
Material Code:	0050A
Material Name:	freon
Case No.:	Not reported
Material FA:	Other
Quantity:	14.00
Units:	L
Recovered:	Not reported
Resource Affected:	Air
Oxygenate:	Not reported

Name:	NATIONAL GRID
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13204
Spill Number/Closed Date:	0801186 / 2008-04-30
Facility ID:	0801186
Facility Type:	ER
DER Facility ID:	346519
Site ID:	397071
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2007-07-30
Investigator:	KCKEMP
Referred To:	DAR
Reported to Dept:	2008-04-29
CID:	404
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	2008-04-30
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2008-04-29
Spill Record Last Update:	2008-04-30
Spiller Name:	SUE SWANSON

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Spiller Company:	NATIONAL GRID
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	001
Contact Name:	SUE SWANSON
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	r22; equipment failure; spoke to Kevin Kemp of Reg 7

All Materials:

Site ID:	397071
Operable Unit ID:	1154031
Operable Unit:	01
Material ID:	2144817
Material Code:	1581A
Material Name:	refrigerant
Case No.:	Not reported
Material FA:	Other
Quantity:	2.00
Units:	L
Recovered:	.00
Resource Affected:	Air
Oxygenate:	Not reported

Name:	NATIONAL GRID
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13204
Spill Number/Closed Date:	0801187 / 2008-04-30
Facility ID:	0801187
Facility Type:	ER
DER Facility ID:	346519
Site ID:	397072
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2007-11-12
Investigator:	KCKEMP
Referred To:	DAR
Reported to Dept:	2008-04-29
CID:	404
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	2008-04-30
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2008-04-29
Spill Record Last Update:	2008-04-30
Spiller Name:	SUE SWANSON
Spiller Company:	NATIONALGRID
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	001
Contact Name:	SUE SWANSON

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	28 ounces released of r22; spoke to Kevin Kemp region 7; equipment failure

All Materials:

Site ID:	397072
Operable Unit ID:	1154032
Operable Unit:	01
Material ID:	2144818
Material Code:	1581A
Material Name:	refrigerant
Case No.:	Not reported
Material FA:	Other
Quantity:	.00
Units:	G
Recovered:	.00
Resource Affected:	Air
Oxygenate:	Not reported

Name:	NAT GRID
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	2204443 / 2022-08-25
Facility ID:	2204443
Facility Type:	ER
DER Facility ID:	327390
Site ID:	641597
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2022-08-19
Investigator:	DGMILLER
Referred To:	Not reported
Reported to Dept:	2022-08-19
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2022-08-19
Spill Record Last Update:	2022-08-25
Spiller Name:	PATRICK BLEHAR
Spiller Company:	NAT GRID EMPLOYEE
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	999
Contact Name:	PATRICK BLEHAR
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	no spill

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Remarks: Loss to parking lot, c/u complete

All Materials:

Site ID:	641597
Operable Unit ID:	1388633
Operable Unit:	01
Material ID:	2403577
Material Code:	0015
Material Name:	motor oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	OFFICE BUILDING
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0906221 / 2009-08-28
Facility ID:	0906221
Facility Type:	ER
DER Facility ID:	327390
Site ID:	418545
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	3415
Spill Date:	2009-08-28
Investigator:	MJROMOCK
Referred To:	Not reported
Reported to Dept:	2009-08-28
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-08-28
Spill Record Last Update:	2009-08-28
Spiller Name:	SUE SWANSON
Spiller Company:	NAT GRID
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	CALLER
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	refrred to NYSDEC Division of Air Resources.
Remarks:	Released to atmosphere.

All Materials:

Site ID:	418545

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Operable Unit ID:	1174707
Operable Unit:	01
Material ID:	2167094
Material Code:	0050A
Material Name:	freon
Case No.:	Not reported
Material FA:	Other
Quantity:	35.00
Units:	L
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	NATIONAL GRID SYRACUSE COMPLEX
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0907853 / 2009-10-13
Facility ID:	0907853
Facility Type:	ER
DER Facility ID:	327390
Site ID:	420406
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	3415
Spill Date:	2009-10-13
Investigator:	menash
Referred To:	Not reported
Reported to Dept:	2009-10-13
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-10-13
Spill Record Last Update:	2009-10-13
Spiller Name:	Not reported
Spiller Company:	NATIONAL GRID SYRACUSE COMPLEX
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	SUE SWANSON
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Company vehicle with leaking gas line-cause. Vehicle bad ordered. Parking lot area cleaned. No further remediation required.
Remarks:	ONTO PAVEMENT; CLEAN UP EN-RTE

All Materials:

Site ID:	420406
Operable Unit ID:	1176376
Operable Unit:	01

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Material ID:	2169064
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	DOWNTOWN OFFICE HQ
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0904025 / 2009-07-07
Facility ID:	0904025
Facility Type:	ER
DER Facility ID:	327390
Site ID:	416166
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	E4
SWIS:	3415
Spill Date:	2009-07-07
Investigator:	kacahill
Referred To:	Not reported
Reported to Dept:	2009-07-07
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-07-07
Spill Record Last Update:	2009-07-07
Spiller Name:	Not reported
Spiller Company:	NAT GRID
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	CALLER
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Referred to Div. of Air
Remarks:	Released to atmosphere. Notification required.

All Materials:

Site ID:	416166
Operable Unit ID:	1172480
Operable Unit:	01
Material ID:	2164352
Material Code:	0050A
Material Name:	freon
Case No.:	Not reported

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Material FA:	Other
Quantity:	9.00
Units:	L
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Name:	AC UNIT - NATIONAL GRID BLDG
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1105869 / 2011-08-24
Facility ID:	1105869
Facility Type:	ER
DER Facility ID:	327390
Site ID:	453537
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	E5
SWIS:	3415
Spill Date:	2011-08-23
Investigator:	DJLASALL
Referred To:	Not reported
Reported to Dept:	2011-08-23
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2011-08-23
Spill Record Last Update:	2011-08-24
Spiller Name:	SUE SWANSON
Spiller Company:	NATIONAL GRID
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	999
Contact Name:	SUE SWANSON
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	R-22. Unit repaired and recharged.

All Materials:

Site ID:	453537
Operable Unit ID:	1203693
Operable Unit:	01
Material ID:	2200369
Material Code:	1581A
Material Name:	refrigerant
Case No.:	Not reported
Material FA:	Other
Quantity:	9.90
Units:	L
Recovered:	Not reported

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Resource Affected:	Air
Oxygenate:	Not reported

Name:	STREETSIDE
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	1103514 / 2011-06-29
Facility ID:	1103514
Facility Type:	ER
DER Facility ID:	327390
Site ID:	451079
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2011-06-28
Investigator:	DJLASALL
Referred To:	Not reported
Reported to Dept:	2011-06-28
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2011-06-28
Spill Record Last Update:	2011-06-29
Spiller Name:	NATIONAL GRID
Spiller Company:	NATIONAL GRID
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	999
Contact Name:	NATIONAL GRID
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	Leaked from NG vehicel onto blacktop parking lot. Cleanup by Op-tech already.

All Materials:

Site ID:	451079
Operable Unit ID:	1201280
Operable Unit:	01
Material ID:	2197797
Material Code:	0015
Material Name:	motor oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Name:	SYRACUSE OFFICE
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY
Spill Number/Closed Date:	0612888 / 2007-07-03
Facility ID:	0612888
Facility Type:	ER
DER Facility ID:	327390
Site ID:	377833
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	3415
Spill Date:	2007-03-01
Investigator:	hdwarner
Referred To:	Not reported
Reported to Dept:	2007-03-01
CID:	444
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2007-03-01
Spill Record Last Update:	2007-07-03
Spiller Name:	BOB CAZZOLLI
Spiller Company:	SYRACUSE OFFICE
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	001
Contact Name:	BOB CAZZOLLI
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	Not reported
Remarks:	LEAKER ON A CHILLER SYSTEM : CONTAINED ON FLORR AND ISOLATED DRAIN: CREW ONM SITE

All Materials:

Site ID:	377833
Operable Unit ID:	1135351
Operable Unit:	01
Material ID:	2125250
Material Code:	0013
Material Name:	lube oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	.00
Resource Affected:	Soil
Oxygenate:	Not reported

Name:	NAT GRID OFFICE / D BLD
Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Spill Number/Closed Date:	1012998 / 2011-03-30
Facility ID:	1012998
Facility Type:	ER
DER Facility ID:	327390
Site ID:	447299
DEC Region:	7
Spill Cause:	Equipment Failure
Spill Class:	E5
SWIS:	3415
Spill Date:	2011-03-30
Investigator:	MJROMOCK
Referred To:	Not reported
Reported to Dept:	2011-03-30
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2011-03-30
Spill Record Last Update:	2011-03-30
Spiller Name:	BOB CAZZOLI
Spiller Company:	NAT GRID OFFICE / D BLD
Spiller Address:	300 ERIE BLVD WEST
Spiller Company:	999
Contact Name:	BOB CAZZOLI
Latitude:	Not reported
Longitude:	Not reported
DEC Memo:	3/30/11 Referred to NYSDEC Division of Air Resources.
Remarks:	leak on fitting, repair pending

All Materials:

Site ID:	447299
Operable Unit ID:	1197442
Operable Unit:	01
Material ID:	2193758
Material Code:	1581A
Material Name:	refrigerant
Case No.:	Not reported
Material FA:	Other
Quantity:	2.00
Units:	G
Recovered:	.00
Resource Affected:	Air
Oxygenate:	Not reported

Click this hyperlink while viewing on your computer to access
7 additional NY SPILL: record(s) in the EDR Site Report.

MGP:

Site ID:	734060
Name:	NM - SYRACUSE ERIE BLVD. MGP

NM - SYRACUSE ERIE BLVD. MGP (Continued) **S111065346**

Address:	300 ERIE BLVD WEST
City,State,Zip:	SYRACUSE, NY 13208-
Region:	7
Class:	Completed: The classification used for sites where the Department has determined that remediation has been satisfactorily completed under a remedial program (i. e., State Superfund, Brownfield Cleanup Program, Environmental Restoration Program, Voluntary Cleanup Program, and RCRA Corrective Action Program). State Superfund (Registry) sites must have completed all active operation, maintenance, or monitoring requirements before they can be delisted and made class C. Non-registry sites may be made a class C after successful completion of all required construction or after a no further action remedy has been selected by the Department. These sites will be issued a Certificate of Completion (COC), but may still require ongoing maintenance and periodic certification of institutional/engineering controls (IC/ECs).
Swis Code:	3415
Town:	Syracuse (c)
Disp Start:	Not reported
Disp Term:	Not reported
Acres:	8.19
Fuse:	Commercial
Description:	Location: The NM-Erie Boulevard MGP Site is an 8.19-acre site located at 300 Erie Boulevard West, in downtown Syracuse. The site is bounded by West Genesee Street to the north, North Franklin Street to the east, Erie Boulevard West to the south and Onondaga Creek to the west. Site Features: The site is relatively flat. There are four adjoining office buildings, and two separate buildings on the site. All buildings are occupied. The remaining site area is covered with paved parking lots and roadways. Current Zoning/Use(s): The site is zoned for commercial use. The immediate surrounding area is zoned for commercial use. Past Use of the Site: The prior uses of the site include three mills (a salt mill, a saw mill, a linseed oil mill) and a tannery. The first manufactured gas plant (MGP) was constructed in 1849 and operated until the 1930s. Site Geology and Hydrogeology: Fill material is present below the asphalt pavement surface cover and ranges in thickness from 3 to 28 feet. The fill unit is underlain by a clay/silt layer. This unit is discontinuous and ranges in thickness from 2 to 22 feet. A sand and gravel unit is encountered beneath the clay/silt layer at depths ranging from 6 to 30 feet below ground surface (bgs). The water table is generally encountered at a depth of approximately 20 feet bgs at the site and flows from south to north. The site is adjacent to Onondaga Creek, which is a losing stream at this location, meaning that water flows from the creek into groundwater. Groundwater is naturally very saline, which renders it unsuitable for potable purposes.
Assess Env:	Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were BTEX and PAHs in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for commercial use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan.
Assess Doh:	Remedial actions are complete and measures are in place to prevent people from coming in contact with residual contamination.
Latitude:	43.05179455
Longitude:	-76.15718559

Count: 5 records. ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
SYRACUSE	S108146406	ROTONDO WAREHOUSE	WEST DIVISION STREET	13204	NY SHWS, NY HSWDS
SYRACUSE	S113916541	W.JEFFERSON ST. ROADWAY&ROW(400 OF	WEST JEFFERSON STREET	13202	NY VCP, NY BROWNFIELDS
SYRACUSE	S113916519	FORM. DUPLI GRAPHICS FACILITY(400	358 WEST JEFFERSON STREET & WE	13202	NY VCP, NY BROWNFIELDS
SYRACUSE	S113492639	SIDA PROPERTIES	SOUTH SALINA/MONTGOMERY STREET	13202	NY SHWS
SYRACUSE	S106905168	OLD TIP-TOP BAKERY	SHONNARD STREET	13204	NY SHWS

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal NPL (Superfund) sites

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: EPA
Telephone: N/A
Last EDR Contact: 06/02/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 3
Telephone 215-814-5418

EPA Region 4
Telephone 404-562-8033

EPA Region 5
Telephone 312-886-6686

EPA Region 10
Telephone 206-553-8665

EPA Region 6
Telephone: 214-655-6659

EPA Region 7
Telephone: 913-551-7247

EPA Region 8
Telephone: 303-312-6774

EPA Region 9
Telephone: 415-947-4246

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: EPA
Telephone: N/A
Last EDR Contact: 06/02/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

Lists of Federal Delisted NPL sites

Delisted NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: EPA
Telephone: N/A
Last EDR Contact: 06/02/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Quarterly

Lists of Federal sites subject to CERCLA removals and CERCLA orders

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 11/20/2024
Date Data Arrived at EDR: 12/18/2024
Date Made Active in Reports: 12/20/2024
Number of Days to Update: 2

Source: Environmental Protection Agency
Telephone: 703-603-8704
Last EDR Contact: 06/20/2025
Next Scheduled EDR Contact: 10/06/2025
Data Release Frequency: Varies

SEMS: Superfund Enterprise Management System

SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly know as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 06/02/2025
Next Scheduled EDR Contact: 07/21/2025
Data Release Frequency: Quarterly

Lists of Federal CERCLA sites with NFRAP

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that. based upon available information, the location is not judged to be potential NPL site.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 06/02/2025
Next Scheduled EDR Contact: 07/21/2025
Data Release Frequency: Quarterly

Lists of Federal RCRA facilities undergoing Corrective Action

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 06/02/2025
Date Data Arrived at EDR: 06/03/2025
Date Made Active in Reports: 06/16/2025
Number of Days to Update: 13

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 06/03/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Quarterly

Lists of Federal RCRA TSD facilities

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 06/02/2025
Date Data Arrived at EDR: 06/04/2025
Date Made Active in Reports: 06/16/2025
Number of Days to Update: 12

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 06/04/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Quarterly

Lists of Federal RCRA generators

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 06/02/2025
Date Data Arrived at EDR: 06/04/2025
Date Made Active in Reports: 06/16/2025
Number of Days to Update: 12

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 06/04/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 06/02/2025
Date Data Arrived at EDR: 06/04/2025
Date Made Active in Reports: 06/16/2025
Number of Days to Update: 12

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 06/04/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Quarterly

RCRA-VSQG: RCRA - Very Small Quantity Generators (Formerly Conditionally Exempt Small Quantity Generators)

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Very small quantity generators (VSQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 06/02/2025
Date Data Arrived at EDR: 06/04/2025
Date Made Active in Reports: 06/16/2025
Number of Days to Update: 12

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 06/04/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Quarterly

Federal institutional controls / engineering controls registries

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 11/11/2024
Date Data Arrived at EDR: 11/25/2024
Date Made Active in Reports: 02/18/2025
Number of Days to Update: 85

Source: Department of the Navy
Telephone: 843-820-7326
Last EDR Contact: 04/30/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Varies

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 01/29/2025
Date Data Arrived at EDR: 02/18/2025
Date Made Active in Reports: 04/29/2025
Number of Days to Update: 70

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 05/20/2025
Next Scheduled EDR Contact: 12/02/2024
Data Release Frequency: Varies

US INST CONTROLS: Institutional Controls Sites List

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 01/29/2025
Date Data Arrived at EDR: 02/18/2025
Date Made Active in Reports: 04/29/2025
Number of Days to Update: 70

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 05/20/2025
Next Scheduled EDR Contact: 09/01/2025
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 06/10/2025
Date Data Arrived at EDR: 06/12/2025
Date Made Active in Reports: 06/16/2025
Number of Days to Update: 4

Source: National Response Center, United States Coast Guard
Telephone: 202-267-2180
Last EDR Contact: 06/12/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Quarterly

Lists of state- and tribal hazardous waste facilities

SHWS: Inactive Hazardous Waste Disposal Sites in New York State

Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites

Date of Government Version: 02/03/2025
Date Data Arrived at EDR: 02/04/2025
Date Made Active in Reports: 04/22/2025
Number of Days to Update: 77

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 05/06/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Annually

Lists of state and tribal landfills and solid waste disposal facilities

SWF/LF: Facility Register

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 02/20/2025
Date Data Arrived at EDR: 03/20/2025
Date Made Active in Reports: 06/09/2025
Number of Days to Update: 81

Source: Department of Environmental Conservation
Telephone: 518-402-8678
Last EDR Contact: 06/17/2025
Next Scheduled EDR Contact: 10/06/2025
Data Release Frequency: Quarterly

Lists of state and tribal leaking storage tanks

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 01/07/2025
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: Environmental Protection Agency
Telephone: 415-972-3372
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land

Leaking underground storage tanks located on Indian Land in Michigan, Minnesota and Wisconsin.

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA, Region 5
Telephone: 312-886-7439
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 6
Telephone: 214-665-6597
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 4
Telephone: 404-562-8677
Last EDR Contact: 01/16/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 01/07/2025
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 8
Telephone: 303-312-6271
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

LTANKS: Spills Information Database
Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills.

Date of Government Version: 02/02/2025
Date Data Arrived at EDR: 02/04/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 79

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 05/06/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Varies

HIST LTANKS: Listing of Leaking Storage Tanks

A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 07/08/2005
Date Made Active in Reports: 07/14/2005
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/07/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

Lists of state and tribal registered storage tanks

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 04/08/2025
Date Data Arrived at EDR: 04/23/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 1

Source: FEMA
Telephone: 202-646-5797
Last EDR Contact: 03/26/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

UST: Petroleum Bulk Storage (PBS) Database

Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 03/17/2025
Date Data Arrived at EDR: 03/19/2025
Date Made Active in Reports: 06/03/2025
Number of Days to Update: 76

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 06/16/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: No Update Planned

CBS UST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in underground tanks of any size

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 10/24/2005
Next Scheduled EDR Contact: 01/23/2006
Data Release Frequency: No Update Planned

MOSF UST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

MOSF: Major Oil Storage Facility Site Listing

These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 03/17/2025
Date Data Arrived at EDR: 03/19/2025
Date Made Active in Reports: 06/03/2025
Number of Days to Update: 76

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 06/16/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CBS: Chemical Bulk Storage Site Listing

These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

Date of Government Version: 03/17/2025
Date Data Arrived at EDR: 03/19/2025
Date Made Active in Reports: 06/03/2025
Number of Days to Update: 76

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 06/16/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Quarterly

AST: Petroleum Bulk Storage

Registered Aboveground Storage Tanks.

Date of Government Version: 03/17/2025
Date Data Arrived at EDR: 03/19/2025
Date Made Active in Reports: 06/03/2025
Number of Days to Update: 76

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 06/16/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: No Update Planned

CBS AST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

MOSF AST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 8
Telephone: 303-312-6137
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 10/15/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 9
Telephone: 415-972-3368
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 5
Telephone: 312-886-6136
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 11/08/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 01/07/2025
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

TANKS: Storage Tank Faciliy Listing

This database contains records of facilities that are or have been regulated under Bulk Storage Program. Tank information for these facilities may not be releasable by the state agency.

Date of Government Version: 03/17/2025
Date Data Arrived at EDR: 03/19/2025
Date Made Active in Reports: 06/03/2025
Number of Days to Update: 76

Source: Department of Environmental Conservation
Telephone: 518-402-9543
Last EDR Contact: 06/16/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Quarterly

State and tribal institutional control / engineering control registries

ENV RES DECL: Environmental Restrictive Declarations

The Environmental Restrictive Declarations (ERD) listed were recorded in connection with a zoning action against the noted Tax Blocks and Tax Lots, or portion thereof, and are available in the property records on file at the Office of the City Register for Bronx, Kings, New York and Queens counties or at the Richmond County Clerk's office. They contain environmental requirements with respect to hazardous materials, air quality and/or noise in accordance with Section 11-15 of this Resolution.

Date of Government Version: 12/06/2024
Date Data Arrived at EDR: 12/11/2024
Date Made Active in Reports: 03/03/2025
Number of Days to Update: 82

Source: New York City Department of City Planning
Telephone: 212-720-3300
Last EDR Contact: 06/10/2025
Next Scheduled EDR Contact: 09/22/2025
Data Release Frequency: Varies

RES DECL: Restrictive Declarations Listing

A restrictive declaration is a covenant running with the land which binds the present and future owners of the property. As a condition of certain special permits, the City Planning Commission may require an applicant to sign and record a restrictive declaration that places specified conditions on the future use and development of the property. Certain restrictive declarations are indicated by a D on zoning maps.

Date of Government Version: 01/31/2025
Date Data Arrived at EDR: 03/11/2025
Date Made Active in Reports: 05/28/2025
Number of Days to Update: 78

Source: NYC Department of City Planning
Telephone: 212-720-3401
Last EDR Contact: 06/10/2025
Next Scheduled EDR Contact: 09/22/2025
Data Release Frequency: Varies

ENG CONTROLS: Registry of Engineering Controls

Environmental Remediation sites that have engineering controls in place.

Date of Government Version: 02/03/2025
Date Data Arrived at EDR: 02/04/2025
Date Made Active in Reports: 04/22/2025
Number of Days to Update: 77

Source: Department of Environmental Conservation
Telephone: 518-402-9553
Last EDR Contact: 05/06/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Quarterly

INST CONTROL: Registry of Institutional Controls

Environmental Remediation sites that have institutional controls in place.

Date of Government Version: 02/03/2025
Date Data Arrived at EDR: 02/04/2025
Date Made Active in Reports: 04/22/2025
Number of Days to Update: 77

Source: Department of Environmental Conservation
Telephone: 518-402-9553
Last EDR Contact: 05/06/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Quarterly

Lists of state and tribal voluntary cleanup sites

VCP: Voluntary Cleanup Agreements

New York established its Voluntary Cleanup Program (VCP) to address the environmental, legal and financial barriers that often hinder the redevelopment and reuse of contaminated properties. The Voluntary Cleanup Program was developed to enhance private sector cleanup of brownfields by enabling parties to remediate sites using private rather than public funds and to reduce the development pressures on "greenfield" sites.

Date of Government Version: 02/03/2025
Date Data Arrived at EDR: 02/04/2025
Date Made Active in Reports: 04/22/2025
Number of Days to Update: 77

Source: Department of Environmental Conservation
Telephone: 518-402-9711
Last EDR Contact: 05/06/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Semi-Annually

INDIAN VCP R7: Voluntary Cleanup Priority Lisitng
A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27

Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 07/08/2021
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

INDIAN VCP R1: Voluntary Cleanup Priority Listing
A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 07/27/2015
Date Data Arrived at EDR: 09/29/2015
Date Made Active in Reports: 02/18/2016
Number of Days to Update: 142

Source: EPA, Region 1
Telephone: 617-918-1102
Last EDR Contact: 06/10/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Varies

VCP NYC: Voluntary Cleanup Program Listing NYC
New York City voluntary cleanup program sites.

Date of Government Version: 03/03/2025
Date Data Arrived at EDR: 03/04/2025
Date Made Active in Reports: 05/21/2025
Number of Days to Update: 78

Source: New York City Office of Environmental Protection
Telephone: 212-788-8841
Last EDR Contact: 06/02/2025
Next Scheduled EDR Contact: 09/15/2025
Data Release Frequency: Varies

Lists of state and tribal brownfield sites

BROWNFIELDS: Brownfields Site List
A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant.

Date of Government Version: 02/03/2025
Date Data Arrived at EDR: 02/04/2025
Date Made Active in Reports: 04/22/2025
Number of Days to Update: 77

Source: Department of Environmental Conservation
Telephone: 518-402-9764
Last EDR Contact: 05/06/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Semi-Annually

ERP: Environmental Restoration Program Listing
In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a $200 million Environmental Restoration or Brownfields Fund as part of the $1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

Date of Government Version: 02/03/2025
Date Data Arrived at EDR: 02/04/2025
Date Made Active in Reports: 04/22/2025
Number of Days to Update: 77

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 05/06/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 09/09/2024
Date Data Arrived at EDR: 09/11/2024
Date Made Active in Reports: 12/06/2024
Number of Days to Update: 86

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 06/10/2025
Next Scheduled EDR Contact: 09/22/2025
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

SWRCY: Registered Recycling Facility List

A listing of recycling facilities.

Date of Government Version: 02/20/2025
Date Data Arrived at EDR: 03/20/2025
Date Made Active in Reports: 06/09/2025
Number of Days to Update: 81

Source: Department of Environmental Conservation
Telephone: 518-402-8678
Last EDR Contact: 06/17/2025
Next Scheduled EDR Contact: 10/06/2025
Data Release Frequency: Quarterly

SWTIRE: Registered Waste Tire Storage & Facility List

A listing of facilities registered to accept waste tires.

Date of Government Version: 02/27/2018
Date Data Arrived at EDR: 04/06/2018
Date Made Active in Reports: 06/08/2018
Number of Days to Update: 63

Source: Department of Environmental Conservation
Telephone: 518-402-8694
Last EDR Contact: 05/21/2025
Next Scheduled EDR Contact: 09/15/2025
Data Release Frequency: No Update Planned

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52

Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 04/21/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Varies

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137

Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: No Update Planned

IHS OPEN DUMPS: Open Dumps on Indian Land

A listing of all open dumps located on Indian Land in the United States.

Date of Government Version: 02/07/2024
Date Data Arrived at EDR: 11/13/2024
Date Made Active in Reports: 11/19/2024
Number of Days to Update: 6

Source: Department of Health & Human Serivces, Indian Health Service
Telephone: 301-443-1452
Last EDR Contact: 04/30/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations that have been removed from the DEAs National Clandestine Laboratory Register.

Date of Government Version: 12/31/2024
Date Data Arrived at EDR: 02/20/2025
Date Made Active in Reports: 04/29/2025
Number of Days to Update: 68

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 06/02/2025
Next Scheduled EDR Contact: 09/01/2025
Data Release Frequency: No Update Planned

DEL SHWS: Delisted Registry Sites

A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

Date of Government Version: 02/03/2025
Date Data Arrived at EDR: 02/04/2025
Date Made Active in Reports: 04/22/2025
Number of Days to Update: 77

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 05/06/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Quarterly

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 12/31/2024
Date Data Arrived at EDR: 02/20/2025
Date Made Active in Reports: 04/29/2025
Number of Days to Update: 68

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 06/02/2025
Next Scheduled EDR Contact: 09/01/2025
Data Release Frequency: Quarterly

Local Lists of Registered Storage Tanks

HIST UST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. It is no longer updated due to the sensitive nature of the information involved. See UST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: Varies

HIST AST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capabilities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. No longer updated due to the sensitive nature of the information involved. See AST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: No Update Planned

Local Land Records

LIENS: Spill Liens Information

Lien information from the Oil Spill Fund.

Date of Government Version: 01/24/2025
Date Data Arrived at EDR: 01/27/2025
Date Made Active in Reports: 04/11/2025
Number of Days to Update: 74

Source: Office of the State Comptroller
Telephone: 518-474-9034
Last EDR Contact: 04/24/2025
Next Scheduled EDR Contact: 08/11/2025
Data Release Frequency: Quarterly

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 06/02/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Semi-Annually

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 06/11/2025
Date Data Arrived at EDR: 06/12/2025
Date Made Active in Reports: 06/16/2025
Number of Days to Update: 4

Source: U.S. Department of Transportation
Telephone: 202-366-4555
Last EDR Contact: 06/12/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Quarterly

SPILLS: Spills Information Database

Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 02/02/2025
Date Data Arrived at EDR: 02/04/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 79

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 05/06/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Varies

HIST SPILLS: SPILLS Database

This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 07/08/2005
Date Made Active in Reports: 07/14/2005
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/07/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 12/14/2012
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 02/12/2013
Number of Days to Update: 40

Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

SPILLS 80: SPILLS80 data from FirstSearch

Spills 80 includes those spill and release records available from FirstSearch databases prior to 1990. Typically, they may include chemical, oil and/or hazardous substance spills recorded before 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 80.

Date of Government Version: 11/02/2010
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 03/07/2013
Number of Days to Update: 63

Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 06/02/2025
Date Data Arrived at EDR: 06/04/2025
Date Made Active in Reports: 06/16/2025
Number of Days to Update: 12

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 06/04/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Quarterly

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 01/30/2025
Date Data Arrived at EDR: 02/11/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 72

Source: U.S. Army Corps of Engineers
Telephone: 202-528-4285
Last EDR Contact: 05/13/2025
Next Scheduled EDR Contact: 08/25/2025
Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 06/07/2021
Date Data Arrived at EDR: 07/13/2021
Date Made Active in Reports: 03/09/2022
Number of Days to Update: 239

Source: USGS
Telephone: 888-275-8747
Last EDR Contact: 04/08/2025
Next Scheduled EDR Contact: 07/21/2025
Data Release Frequency: Varies

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 04/02/2018
Date Data Arrived at EDR: 04/11/2018
Date Made Active in Reports: 11/06/2019
Number of Days to Update: 574

Source: U.S. Geological Survey
Telephone: 888-275-8747
Last EDR Contact: 04/03/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: N/A

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 07/30/2021
Date Data Arrived at EDR: 02/03/2023
Date Made Active in Reports: 02/10/2023
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 05/08/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 06/02/2025
Date Data Arrived at EDR: 06/03/2025
Date Made Active in Reports: 06/16/2025
Number of Days to Update: 13

Source: Environmental Protection Agency
Telephone: 202-566-1917
Last EDR Contact: 06/03/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Quarterly

EPA WATCH LIST: EPA Watch List

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 08/30/2013
Date Data Arrived at EDR: 03/21/2014
Date Made Active in Reports: 06/17/2014
Number of Days to Update: 88

Source: Environmental Protection Agency
Telephone: 617-520-3000
Last EDR Contact: 04/28/2025
Next Scheduled EDR Contact: 08/11/2025
Data Release Frequency: No Update Planned

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 09/30/2017
Date Data Arrived at EDR: 05/08/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 73

Source: Environmental Protection Agency
Telephone: 703-308-4044
Last EDR Contact: 05/01/2025
Next Scheduled EDR Contact: 08/11/2025
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2020
Date Data Arrived at EDR: 06/14/2022
Date Made Active in Reports: 03/24/2023
Number of Days to Update: 283

Source: EPA
Telephone: 202-260-5521
Last EDR Contact: 06/12/2025
Next Scheduled EDR Contact: 09/22/2025
Data Release Frequency: Every 4 Years

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2023
Date Data Arrived at EDR: 02/11/2025
Date Made Active in Reports: 02/18/2025
Number of Days to Update: 7

Source: EPA
Telephone: 202-566-0250
Last EDR Contact: 05/15/2025
Next Scheduled EDR Contact: 08/25/2025
Data Release Frequency: Annually

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 01/13/2025
Date Data Arrived at EDR: 01/15/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 82

Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 04/15/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Annually

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 04/25/2025
Date Data Arrived at EDR: 05/01/2025
Date Made Active in Reports: 05/21/2025
Number of Days to Update: 20

Source: EPA
Telephone: 703-416-0223
Last EDR Contact: 06/02/2025
Next Scheduled EDR Contact: 09/08/2025
Data Release Frequency: Annually

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 01/01/2025
Date Data Arrived at EDR: 01/17/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 80
Source: Environmental Protection Agency
Telephone: 202-564-8600
Last EDR Contact: 04/10/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995
Date Data Arrived at EDR: 07/03/1995
Date Made Active in Reports: 08/07/1995
Number of Days to Update: 35
Source: EPA
Telephone: 202-564-4104
Last EDR Contact: 06/02/2008
Next Scheduled EDR Contact: 09/01/2008
Data Release Frequency: No Update Planned

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 02/26/2025
Date Data Arrived at EDR: 03/03/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 35
Source: EPA
Telephone: 202-564-6023
Last EDR Contact: 06/02/2025
Next Scheduled EDR Contact: 08/11/2025
Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 07/01/2024
Date Data Arrived at EDR: 10/02/2024
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 100
Source: EPA
Telephone: 202-566-0500
Last EDR Contact: 04/03/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 11/18/2016
Date Data Arrived at EDR: 11/23/2016
Date Made Active in Reports: 02/10/2017
Number of Days to Update: 79
Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 03/26/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25
Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Telephone: 202-566-1667
Last EDR Contact: 08/18/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: No Update Planned

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25
Source: EPA
Telephone: 202-566-1667
Last EDR Contact: 08/18/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: No Update Planned

MLTS: Material Licensing Tracking System
MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 05/07/2025
Date Data Arrived at EDR: 05/07/2025
Date Made Active in Reports: 06/03/2025
Number of Days to Update: 27
Source: Nuclear Regulatory Commission
Telephone: 301-415-0717
Last EDR Contact: 04/10/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Quarterly

COAL ASH DOE: Steam-Electric Plant Operation Data
A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2023
Date Data Arrived at EDR: 10/16/2024
Date Made Active in Reports: 01/14/2025
Number of Days to Update: 90
Source: Department of Energy
Telephone: 202-586-8719
Last EDR Contact: 05/22/2025
Next Scheduled EDR Contact: 09/08/2025
Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List
A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 01/12/2017
Date Data Arrived at EDR: 03/05/2019
Date Made Active in Reports: 11/11/2019
Number of Days to Update: 251
Source: Environmental Protection Agency
Telephone: N/A
Last EDR Contact: 05/22/2025
Next Scheduled EDR Contact: 09/08/2025
Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database
The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 09/13/2019
Date Data Arrived at EDR: 11/06/2019
Date Made Active in Reports: 02/10/2020
Number of Days to Update: 96
Source: Environmental Protection Agency
Telephone: 202-566-0517
Last EDR Contact: 05/01/2025
Next Scheduled EDR Contact: 08/11/2025
Data Release Frequency: Varies

RADINFO: Radiation Information Database
The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 07/01/2019
Date Data Arrived at EDR: 07/01/2019
Date Made Active in Reports: 09/23/2019
Number of Days to Update: 84

Source: Environmental Protection Agency
Telephone: 202-343-9775
Last EDR Contact: 06/17/2025
Next Scheduled EDR Contact: 10/06/2025
Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2007
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

DOT OPS: Incident and Accident Data

Department of Transporation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 01/10/2025
Date Data Arrived at EDR: 01/22/2025
Date Made Active in Reports: 04/21/2025
Number of Days to Update: 89

Source: Department of Transporation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 04/22/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Quarterly

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 12/31/2024
Date Data Arrived at EDR: 01/27/2025
Date Made Active in Reports: 04/21/2025
Number of Days to Update: 84

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 03/26/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2023
Date Data Arrived at EDR: 02/19/2025
Date Made Active in Reports: 03/07/2025
Number of Days to Update: 16

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 06/03/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Biennially

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 07/14/2015
Date Made Active in Reports: 01/10/2017
Number of Days to Update: 546

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 04/01/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Semi-Annually

FUSRAP: Formerly Utilized Sites Remedial Action Program

DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations.

Date of Government Version: 03/03/2023
Date Data Arrived at EDR: 03/03/2023
Date Made Active in Reports: 06/09/2023
Number of Days to Update: 98

Source: Department of Energy
Telephone: 202-586-3559
Last EDR Contact: 05/01/2025
Next Scheduled EDR Contact: 08/11/2025
Data Release Frequency: Varies

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 02/12/2025
Date Data Arrived at EDR: 02/12/2025
Date Made Active in Reports: 02/27/2025
Number of Days to Update: 15

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 05/15/2025
Next Scheduled EDR Contact: 08/25/2025
Data Release Frequency: Varies

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: Environmental Protection Agency
Telephone: 703-603-8787
Last EDR Contact: 06/02/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931and 1964. These sites may pose a threat to public health through ingestion or inhalation of contaminated soil or dust

Date of Government Version: 04/05/2001
Date Data Arrived at EDR: 10/27/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 36

Source: American Journal of Public Health
Telephone: 703-305-6451
Last EDR Contact: 12/02/2009
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)

The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US AIRS MINOR: Air Facility System Data

A listing of minor source facilities.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 02/03/2025
Date Data Arrived at EDR: 02/18/2025
Date Made Active in Reports: 03/20/2025
Number of Days to Update: 30

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 05/20/2025
Next Scheduled EDR Contact: 09/01/2025
Data Release Frequency: Semi-Annually

MINES VIOLATIONS: MSHA Violation Assessment Data

Mines violation and assessment information. Department of Labor, Mine Safety & Health Administration.

Date of Government Version: 02/19/2025
Date Data Arrived at EDR: 02/21/2025
Date Made Active in Reports: 03/20/2025
Number of Days to Update: 27

Source: DOL, Mine Safety & Health Admi
Telephone: 202-693-9424
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 09/01/2025
Data Release Frequency: Quarterly

US MINES 2: Ferrous and Nonferrous Metal Mines Database Listing

This map layer includes ferrous (ferrous metal mines are facilities that extract ferrous metals, such as iron ore or molybdenum) and nonferrous (Nonferrous metal mines are facilities that extract nonferrous metals, such as gold, silver, copper, zinc, and lead) metal mines in the United States.

Date of Government Version: 05/02/2024
Date Data Arrived at EDR: 08/20/2024
Date Made Active in Reports: 10/09/2024
Number of Days to Update: 50

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 05/20/2025
Next Scheduled EDR Contact: 09/01/2025
Data Release Frequency: Varies

US MINES 3: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011
Date Data Arrived at EDR: 06/08/2011
Date Made Active in Reports: 09/13/2011
Number of Days to Update: 97

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 05/22/2025
Next Scheduled EDR Contact: 09/01/2025
Data Release Frequency: Varies

ABANDONED MINES: Abandoned Mines

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by OSMRE to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

Date of Government Version: 05/28/2025
Date Data Arrived at EDR: 05/28/2025
Date Made Active in Reports: 06/03/2025
Number of Days to Update: 6

Source: Department of Interior
Telephone: 202-208-2609
Last EDR Contact: 05/28/2025
Next Scheduled EDR Contact: 09/15/2025
Data Release Frequency: Quarterly

MINES MRDS: Mineral Resources Data System
Mineral Resources Data System

Date of Government Version: 06/04/2024
Date Data Arrived at EDR: 11/22/2024
Date Made Active in Reports: 02/18/2025
Number of Days to Update: 88

Source: USGS
Telephone: 703-648-6533
Last EDR Contact: 05/22/2025
Next Scheduled EDR Contact: 09/01/2025
Data Release Frequency: Varies

FINDS: Facility Index System/Facility Registry System
Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 04/22/2025
Date Data Arrived at EDR: 05/05/2025
Date Made Active in Reports: 05/21/2025
Number of Days to Update: 16

Source: EPA
Telephone: (212) 637-3000
Last EDR Contact: 05/05/2025
Next Scheduled EDR Contact: 09/08/2025
Data Release Frequency: Quarterly

ECHO: Enforcement & Compliance History Information
ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

Date of Government Version: 12/21/2024
Date Data Arrived at EDR: 12/27/2024
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 14

Source: Environmental Protection Agency
Telephone: 202-564-2280
Last EDR Contact: 03/27/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Quarterly

UXO: Unexploded Ordnance Sites
A listing of unexploded ordnance site locations

Date of Government Version: 02/14/2025
Date Data Arrived at EDR: 03/11/2025
Date Made Active in Reports: 06/03/2025
Number of Days to Update: 84

Source: Department of Defense
Telephone: 703-704-1564
Last EDR Contact: 04/03/2025
Next Scheduled EDR Contact: 07/21/2025
Data Release Frequency: Varies

DOCKET HWC: Hazardous Waste Compliance Docket Listing
A complete list of the Federal Agency Hazardous Waste Compliance Docket Facilities.

Date of Government Version: 05/06/2021
Date Data Arrived at EDR: 05/21/2021
Date Made Active in Reports: 08/11/2021
Number of Days to Update: 82

Source: Environmental Protection Agency
Telephone: 202-564-0527
Last EDR Contact: 05/14/2025
Next Scheduled EDR Contact: 09/01/2025
Data Release Frequency: Varies

FUELS PROGRAM: EPA Fuels Program Registered Listing
This listing includes facilities that are registered under the Part 80 (Code of Federal Regulations) EPA Fuels Programs. All companies now are required to submit new and updated registrations.

Date of Government Version: 02/13/2025
Date Data Arrived at EDR: 02/13/2025
Date Made Active in Reports: 04/29/2025
Number of Days to Update: 75

Source: EPA
Telephone: 800-385-6164
Last EDR Contact: 05/13/2025
Next Scheduled EDR Contact: 08/25/2025
Data Release Frequency: Quarterly

PFAS NPL: Superfund Sites with PFAS Detections Information

EPA's Office of Land and Emergency Management and EPA Regional Offices maintain data describing what is known about site investigations, contamination, and remedial actions under the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) where PFAS is present in the environment.

Date of Government Version: 03/31/2025
Date Data Arrived at EDR: 04/02/2025
Date Made Active in Reports: 05/05/2025
Number of Days to Update: 33

Source: Environmental Protection Agency
Telephone: 703-603-8895
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS FEDERAL SITES: Federal Sites PFAS Information

Several federal entities, such as the federal Superfund program, Department of Defense, National Aeronautics and Space Administration, Department of Transportation, and Department of Energy provided information for sites with known or suspected detections at federal facilities.

Date of Government Version: 03/31/2025
Date Data Arrived at EDR: 04/02/2025
Date Made Active in Reports: 05/05/2025
Number of Days to Update: 33

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS TRIS: List of PFAS Added to the TRI

Section 7321 of the National Defense Authorization Act for Fiscal Year 2020 (NDAA) immediately added certain per- and polyfluoroalkyl substances (PFAS) to the list of chemicals covered by the Toxics Release Inventory (TRI) under Section 313 of the Emergency Planning and Community Right-to-Know Act (EPCRA) and provided a framework for additional PFAS to be added to TRI on an annual basis.

Date of Government Version: 03/07/2025
Date Data Arrived at EDR: 04/02/2025
Date Made Active in Reports: 05/05/2025
Number of Days to Update: 33

Source: Environmental Protection Agency
Telephone: 202-566-0250
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS TSCA: PFAS Manufacture and Imports Information

EPA issued the Chemical Data Reporting (CDR) Rule under the Toxic Substances Control Act (TSCA) and requires chemical manufacturers and facilities that manufacture or import chemical substances to report data to EPA. EPA publishes non-confidential business information (non-CBI) and includes descriptive information about each site, corporate parent, production volume, other manufacturing information, and processing and use information.

Date of Government Version: 03/31/2025
Date Data Arrived at EDR: 04/02/2025
Date Made Active in Reports: 05/05/2025
Number of Days to Update: 33

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS RCRA MANIFEST: PFAS Transfers Identified In the RCRA Database Listing

To work around the lack of PFAS waste codes in the RCRA database, EPA developed the PFAS Transfers dataset by mining e-Manifest records containing at least one of these common PFAS keywords: PFAS, PFOA, PFOS, PERFL, AFFF, GENX, GEN-X (plus the VT waste codes). These keywords were searched for in the following text fields: Manifest handling instructions (MANIFEST_HANDLING_INSTR), Non-hazardous waste description (NON_HAZ_WASTE_DESCRIPTION), DOT printed information (DOT_PRINTED_INFORMATION), Waste line handling instructions (WASTE_LINE_HANDLING_INSTR), Waste residue comments (WASTE_RESIDUE_COMMENTS).

Date of Government Version: 03/23/2025
Date Data Arrived at EDR: 04/02/2025
Date Made Active in Reports: 05/05/2025
Number of Days to Update: 33

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS ATSDR: PFAS Contamination Site Location Listing

PFAS contamination site locations from the Department of Health & Human Services, Center for Disease Control & Prevention. ATSDR is involved at a number of PFAS-related sites, either directly or through assisting state and federal partners. As of now, most sites are related to drinking water contamination connected with PFAS production facilities or fire training areas where aqueous film-forming firefighting foam (AFFF) was regularly used.

Date of Government Version: 06/24/2020
Date Data Arrived at EDR: 03/17/2021
Date Made Active in Reports: 11/08/2022
Number of Days to Update: 601

Source: Department of Health & Human Services
Telephone: 202-741-5770
Last EDR Contact: 04/17/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Varies

PFAS WQP: Ambient Environmental Sampling for PFAS

The Water Quality Portal (WQP) is a part of a modernized repository storing ambient sampling data for all environmental media and tissue samples. A wide range of federal, state, tribal and local governments, academic and non-governmental organizations and individuals submit project details and sampling results to this public repository. The information is commonly used for research and assessments of environmental quality.

Date of Government Version: 03/03/2025
Date Data Arrived at EDR: 04/02/2025
Date Made Active in Reports: 05/21/2025
Number of Days to Update: 49

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS NPDES: Clean Water Act Discharge Monitoring Information

Any discharger of pollutants to waters of the United States from a point source must have a National Pollutant Discharge Elimination System (NPDES) permit. The process for obtaining limits involves the regulated entity (permittee) disclosing releases in a NPDES permit application and the permitting authority (typically the state but sometimes EPA) deciding whether to require monitoring or monitoring with limits. Caveats and Limitations: Less than half of states have required PFAS monitoring for at least one of their permittees and fewer states have established PFAS effluent limits for permittees. New rulemakings have been initiated that may increase the number of facilities monitoring for PFAS in the future.

Date of Government Version: 03/24/2025
Date Data Arrived at EDR: 04/02/2025
Date Made Active in Reports: 05/21/2025
Number of Days to Update: 49

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS PROJECT: NORTHEASTERN UNIVERSITY PFAS PROJECT

The PFAS Contamination Site Tracker records qualitative and quantitative data from each site in a chart, specifically examining discovery, contamination levels, government response, litigation, health impacts, media coverage, and community characteristics. All data presented in the chart were extracted from government websites, such as state health departments or the Environmental Protection Agency, and news articles.

Date of Government Version: 05/15/2024
Date Data Arrived at EDR: 03/06/2025
Date Made Active in Reports: 06/03/2025
Number of Days to Update: 89

Source: Social Science Environmental Health Research Institute
Telephone: N/A
Last EDR Contact: 06/05/2025
Next Scheduled EDR Contact: 09/15/2025
Data Release Frequency: Varies

PFAS ECHO: Facilities in Industries that May Be Handling PFAS Listing

Regulators and the public have expressed interest in knowing which regulated entities may be using PFAS. EPA has developed a dataset from various sources that show which industries may be handling PFAS. Approximately 120,000 facilities subject to federal environmental programs have operated or currently operate in industry sectors with processes that may involve handling and/or release of PFAS.

Date of Government Version: 03/24/2025
Date Data Arrived at EDR: 04/02/2025
Date Made Active in Reports: 05/21/2025
Number of Days to Update: 49

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS ECHO FIRE TRAIN: Facilities in Industries that May Be Handling PFAS Listing

A list of fire training sites was added to the Industry Sectors dataset using a keyword search on the permitted facilitys name to identify sites where fire-fighting foam may have been used in training exercises. Additionally, you may view an example spreadsheet of the subset of fire training facility data, as well as the keywords used in selecting or deselecting a facility for the subset. as well as the keywords used in selecting or deselecting a facility for the subset. These keywords were tested to maximize accuracy in selecting facilities that may use fire-fighting foam in training exercises, however, due to the lack of a required reporting field in the data systems for designating fire training sites, this methodology may not identify all fire training sites or may potentially misidentify them.

Date of Government Version: 03/24/2025
Date Data Arrived at EDR: 04/02/2025
Date Made Active in Reports: 05/21/2025
Number of Days to Update: 49

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS PT 139 AIRPORT: All Certified Part 139 Airports PFAS Information Listing

Since July 1, 2006, all certified part 139 airports are required to have fire-fighting foam onsite that meet military specifications (MIL-F-24385) (14 CFR 139.317). To date, these military specification fire-fighting foams are fluorinated and have been historically used for training and extinguishing. The 2018 FAA Reauthorization Act has a provision stating that no later than October 2021, FAA shall not require the use of fluorinated AFFF. This provision does not prohibit the use of fluorinated AFFF at Part 139 civilian airports; it only prohibits FAA from mandating its use. The Federal Aviation Administration?s document AC 150/5210-6D - Aircraft Fire Extinguishing Agents provides guidance on Aircraft Fire Extinguishing Agents, which includes Aqueous Film Forming Foam (AFFF).

Date of Government Version: 03/24/2025
Date Data Arrived at EDR: 04/02/2025
Date Made Active in Reports: 05/21/2025
Number of Days to Update: 49

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

AQUEOUS FOAM NRC: Aqueous Foam Related Incidents Listing

The National Response Center (NRC) serves as an emergency call center that fields initial reports for pollution and railroad incidents and forwards that information to appropriate federal/state agencies for response. The spreadsheets posted to the NRC website contain initial incident data that has not been validated or investigated by a federal/state response agency. Response center calls from 1990 to the most recent complete calendar year where there was indication of Aqueous Film Forming Foam (AFFF) usage are included in this dataset. NRC calls may reference AFFF usage in the ?Material Involved? or ?Incident Description? fields.

Date of Government Version: 03/24/2025
Date Data Arrived at EDR: 04/02/2025
Date Made Active in Reports: 04/29/2025
Number of Days to Update: 27

Source: Environmental Protection Agency
Telephone: 202-267-2675
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PCS: Permit Compliance System

PCS is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

Date of Government Version: 12/16/2016
Date Data Arrived at EDR: 01/06/2017
Date Made Active in Reports: 03/10/2017
Number of Days to Update: 63

Source: EPA, Office of Water
Telephone: 202-564-2496
Last EDR Contact: 03/27/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: No Update Planned

PCS ENF: Enforcement data
No description is available for this data

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 02/05/2015
Date Made Active in Reports: 03/06/2015
Number of Days to Update: 29

Source: EPA
Telephone: 202-564-2497
Last EDR Contact: 03/27/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

BIOSOLIDS: ICIS-NPDES Biosolids Facility Data
The data reflects compliance information about facilities in the biosolids program.

Date of Government Version: 01/12/2025
Date Data Arrived at EDR: 01/14/2025
Date Made Active in Reports: 03/20/2025
Number of Days to Update: 65

Source: Environmental Protection Agency
Telephone: 202-564-4700
Last EDR Contact: 04/15/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

UST FINDER: UST Finder Database
EPA developed UST Finder, a web map application containing a comprehensive, state-sourced national map of underground storage tank (UST) and leaking UST (LUST) data. It provides the attributes and locations of active and closed USTs, UST facilities, and LUST sites from states and from Tribal lands and US territories . UST Finder contains information about proximity of UST facilities and LUST sites to: surface and groundwater public drinking water protection areas; estimated number of private domestic wells and number of people living nearby; and flooding and wildfires.

Date of Government Version: 06/08/2023
Date Data Arrived at EDR: 10/04/2023
Date Made Active in Reports: 01/18/2024
Number of Days to Update: 106

Source: Environmental Protection Agency
Telephone: 202-564-0394
Last EDR Contact: 05/08/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Varies

UST FINDER RELEASE: UST Finder Releases Database
US EPA's UST Finder data is a national composite of leaking underground storage tanks. This data contains information about, and locations of, leaking underground storage tanks. Data was collected from state sources and standardized into a national profile by EPA's Office of Underground Storage Tanks, Office of Research and Development, and the Association of State and Territorial Solid Waste Management Officials.

Date of Government Version: 06/08/2023
Date Data Arrived at EDR: 10/31/2023
Date Made Active in Reports: 01/18/2024
Number of Days to Update: 79

Source: Environmental Protecton Agency
Telephone: 202-564-0394
Last EDR Contact: 05/08/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Semi-Annually

E MANIFEST: Hazardous Waste Electronic Manifest System
EPA established a national system for tracking hazardous waste shipments electronically. This system, known as ?e-Manifest,? will modernize the nation?s cradle-to-grave hazardous waste tracking process while saving valuable time, resources, and dollars for industry and states.

Date of Government Version: 02/17/2025
Date Data Arrived at EDR: 02/19/2025
Date Made Active in Reports: 03/14/2025
Number of Days to Update: 23

Source: Environmental Protection Agency
Telephone: 833-501-6826
Last EDR Contact: 06/04/2025
Next Scheduled EDR Contact: 09/29/2025
Data Release Frequency: Varies

PFAS 3: PFAS Environmental Site Remediation List
A list of records included in the Environmental Remediation database whose material is listed as Perfluorooctanoic Acid or Perfluorooctane Sulfonic Acid.

Date of Government Version: 02/03/2025
Date Data Arrived at EDR: 02/04/2025
Date Made Active in Reports: 04/22/2025
Number of Days to Update: 77

Source: Department of Environmental Conservation
Telephone: 518-402-9759
Last EDR Contact: 05/06/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Varies

PFAS 2: New York State Inactive Landfill Initiative

A list of landfills that were investigated and the analytical results for PFOA and PFOS for those landfills. These data represent the landfills from the ILI database that were investigated.

Date of Government Version: 12/12/2022
Date Data Arrived at EDR: 08/10/2023
Date Made Active in Reports: 10/25/2023
Number of Days to Update: 76

Source: Department of Environmental Conservation
Telephone: 518-402-9662
Last EDR Contact: 04/24/2025
Next Scheduled EDR Contact: 08/11/2025
Data Release Frequency: Varies

PFAS: PFAS Contamination Site Location Listing

DEC surveyed select businesses, fire departments, fire training centers, bulk storage facilities, airports, and Department of Defense (DoD) facilities. The responses to the survey have helped to determine if these entities used or stored materials containing PFOA/PFOS including AFFF and dispersants used in Teflon coating operations. The results of this survey will be updated periodically as additional responses are received..

Date of Government Version: 01/16/2019
Date Data Arrived at EDR: 05/08/2019
Date Made Active in Reports: 06/24/2019
Number of Days to Update: 47

Source: Department of Environmental Conservation
Telephone: 518-402-9020
Last EDR Contact: 05/01/2025
Next Scheduled EDR Contact: 08/11/2025
Data Release Frequency: Varies

AIRS: Air Emissions Data

Point source emissions inventory data.

Date of Government Version: 01/09/2025
Date Data Arrived at EDR: 01/29/2025
Date Made Active in Reports: 04/11/2025
Number of Days to Update: 72

Source: Department of Environmental Conservation
Telephone: 518-402-8452
Last EDR Contact: 04/10/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Annually

COAL ASH: Coal Ash Disposal Site Listing

A listing of coal ash disposal site locations.

Date of Government Version: 02/24/2025
Date Data Arrived at EDR: 03/20/2025
Date Made Active in Reports: 06/09/2025
Number of Days to Update: 81

Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 06/17/2025
Next Scheduled EDR Contact: 10/06/2025
Data Release Frequency: Quarterly

DRYCLEANERS: Registered Drycleaners

A listing of all registered drycleaning facilities.

Date of Government Version: 03/05/2025
Date Data Arrived at EDR: 03/13/2025
Date Made Active in Reports: 05/27/2025
Number of Days to Update: 75

Source: Department of Environmental Conservation
Telephone: 518-402-8403
Last EDR Contact: 05/28/2025
Next Scheduled EDR Contact: 09/15/2025
Data Release Frequency: Annually

E DESIGNATION: E DESIGNATION SITE LISTING

The (E (Environmental)) designation would ensure that sampling and remediation take place on the subject properties, and would avoid any significant impacts related to hazardous materials at these locations. The (E) designations would require that the fee owner of the sites conduct a testing and sampling protocol, and remediation where appropriate, to the satisfaction of the NYCDEP before the issuance of a building permit by the Department of Buildings pursuant to the provisions of Section 11-15 of the Zoning Resolution (Environmental Requirements). The (E) designations also include a mandatory construction-related health and safety plan which must be approved by NYCDEP.

Date of Government Version: 02/20/2025
Date Data Arrived at EDR: 03/11/2025
Date Made Active in Reports: 05/28/2025
Number of Days to Update: 78

Source: New York City Department of City Planning
Telephone: 718-595-6658
Last EDR Contact: 06/10/2025
Next Scheduled EDR Contact: 09/22/2025
Data Release Frequency: Semi-Annually

FIN ASSURANCE 1: Financial Assurance Information Listing

Financial assurance information.

Date of Government Version: 03/26/2025
Date Data Arrived at EDR: 03/27/2025
Date Made Active in Reports: 06/18/2025
Number of Days to Update: 83

Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 06/17/2025
Next Scheduled EDR Contact: 10/06/2025
Data Release Frequency: Quarterly

FIN ASSURANCE 2: Financial Assurance Information Listing

A listing of financial assurance information for hazardous waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 08/30/2024
Date Data Arrived at EDR: 08/30/2024
Date Made Active in Reports: 09/13/2024
Number of Days to Update: 14

Source: Department of Environmental Conservation
Telephone: 518-402-8712
Last EDR Contact: 05/28/2025
Next Scheduled EDR Contact: 09/15/2025
Data Release Frequency: Varies

HSWDS: Hazardous Substance Waste Disposal Site Inventory

The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-Registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The last version of the study inventory is frozen in time. The sites on the study will not automatically be made Superfund sites, rather each site will be further evaluated for listing on the Registry. So overtime they will be added to the registry or not.

Date of Government Version: 01/01/2003
Date Data Arrived at EDR: 10/20/2006
Date Made Active in Reports: 11/30/2006
Number of Days to Update: 41

Source: Department of Environmental Conservation
Telephone: 518-402-9564
Last EDR Contact: 05/26/2009
Next Scheduled EDR Contact: 08/24/2009
Data Release Frequency: No Update Planned

NYC LEAD: Lead-based Paint Testing Results

The results of the inspections for all classrooms serving students under six in applicable buildings. Identifies all classrooms, whether there was observation of peeling paint, and if there was, standard response protocol was followed.

Date of Government Version: 12/12/2024
Date Data Arrived at EDR: 01/28/2025
Date Made Active in Reports: 04/11/2025
Number of Days to Update: 73

Source: New York City Department of Education
Telephone: 212-374-5141
Last EDR Contact: 04/29/2025
Next Scheduled EDR Contact: 08/11/2025
Data Release Frequency: Varies

NYC LEAD 2: Recent Lead Paint Violations

Pursuant to New York City?s Housing Maintenance Code, the Department of Housing Preservation and Development (HPD) issues violations against conditions in rental dwelling units that have been verified to violate the New York City Housing Maintenance Code (HMC) or the New York State Multiple Dwelling Law (MDL). Violations are issued when an inspection verifies that a violation of the HMC or MDL exists. It is closed when the violation is corrected, as observed/verified by HPD or as certified by the landlord.

Date of Government Version: 01/27/2025
Date Data Arrived at EDR: 01/28/2025
Date Made Active in Reports: 04/11/2025
Number of Days to Update: 73

Source: New York City Department of Housing Preservation & Development
Telephone: 212-863-8200
Last EDR Contact: 04/29/2025
Next Scheduled EDR Contact: 08/11/2025
Data Release Frequency: Varies

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 12/31/2019
Date Data Arrived at EDR: 11/30/2023
Date Made Active in Reports: 12/01/2023
Number of Days to Update: 1

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 04/24/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Quarterly

SPDES: State Pollutant Discharge Elimination System

New York State has a state program which has been approved by the United States Environmental Protection Agency for the control of wastewater and stormwater discharges in accordance with the Clean Water Act. Under New York State law the program is known as the State Pollutant Discharge Elimination System (SPDES) and is broader in scope than that required by the Clean Water Act in that it controls point source discharges to groundwaters as well as surface waters.

Date of Government Version: 01/09/2025
Date Data Arrived at EDR: 01/15/2025
Date Made Active in Reports: 04/04/2025
Number of Days to Update: 79

Source: Department of Environmental Conservation
Telephone: 518-402-8233
Last EDR Contact: 04/10/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: No Update Planned

VAPOR REOPENED: Vapor Intrusion Legacy Site List

New York is currently re-evaluating previous assumptions and decisions regarding the potential for soil vapor intrusion exposures at sites. As a result, all past, current, and future contaminated sites will be evaluated to determine whether these sites have the potential for exposures related to soil vapor intrusion.

Date of Government Version: 01/01/2022
Date Data Arrived at EDR: 02/08/2022
Date Made Active in Reports: 05/06/2022
Number of Days to Update: 87

Source: Department of Environmenal Conservation
Telephone: 518-402-9814
Last EDR Contact: 05/08/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: Varies

UIC: Underground Injection Control Wells

A listing of enhanced oil recovery underground injection wells.

Date of Government Version: 02/23/2025
Date Data Arrived at EDR: 02/25/2025
Date Made Active in Reports: 05/09/2025
Number of Days to Update: 73

Source: Department of Environmental Conservation
Telephone: 518-402-8056
Last EDR Contact: 05/27/2025
Next Scheduled EDR Contact: 09/08/2025
Data Release Frequency: Quarterly

COOLING TOWERS: Registered Cooling Towers

This data includes the location of cooling towers registered with New York State. The data is self-reported by owners/property managers of cooling towers in service in New York State. In August 2015, the New York State Department of Health released emergency regulations requiring the owners of cooling towers to register them with New York State.

Date of Government Version: 12/31/2024
Date Data Arrived at EDR: 01/07/2025
Date Made Active in Reports: 03/25/2025
Number of Days to Update: 77

Source: Department of Health
Telephone: 518-402-7650
Last EDR Contact: 04/08/2025
Next Scheduled EDR Contact: 07/21/2025
Data Release Frequency: Varies

NYC LAND USE: New York City Land Use Information
Land use colors

Date of Government Version: 02/21/2025
Date Data Arrived at EDR: 03/11/2025
Date Made Active in Reports: 05/28/2025
Number of Days to Update: 78

Source: New York City Department of City Planning
Telephone: 212-720-3300
Last EDR Contact: 06/10/2025
Next Scheduled EDR Contact: 09/22/2025
Data Release Frequency: Varies

MGP: Manufactured Gas Plants Listing
From the late 1800's to the mid 1900's, hundreds of manufactured gas plants across New York State supplied homes and industry with fuel for heating, cooking, and lighting. Today, the New York State DEC is overseeing the investigation and cleanup of contamination left behind from these plants.

Date of Government Version: 02/28/2025
Date Data Arrived at EDR: 03/04/2025
Date Made Active in Reports: 05/21/2025
Number of Days to Update: 78

Source: Department of Environmental Conservation
Telephone: 518-402-9662
Last EDR Contact: 06/16/2025
Next Scheduled EDR Contact: 09/15/2025
Data Release Frequency: Varies

NYC OER: OER Cleanup Sites Listing
Properties remediated under OER's oversight, both in the E-Designation program and the NYC Voluntary Cleanup Program. Includes sites completed and in progress.

Date of Government Version: 03/03/2025
Date Data Arrived at EDR: 03/04/2025
Date Made Active in Reports: 05/21/2025
Number of Days to Update: 78

Source: Office of Environmental Remediation
Telephone: 212-788-8841
Last EDR Contact: 06/02/2025
Next Scheduled EDR Contact: 09/15/2025
Data Release Frequency: Varies

ILI: New York State Inactive Landfill Initiative
A solid waste site priority list of mitigation and remedial activities to address sites causing, or substantially contributing to, impairments of drinking water quality. Inactive solid waste disposal sites, primarily landfills, and their potential impact on New York?s drinking water resources from site-related contaminants, with a focus on emerging contaminants.

Date of Government Version: 05/16/2024
Date Data Arrived at EDR: 05/30/2024
Date Made Active in Reports: 08/26/2024
Number of Days to Update: 88

Source: Department of Environmental Conservation
Telephone: 518-402-8671
Last EDR Contact: 04/24/2025
Next Scheduled EDR Contact: 08/11/2025
Data Release Frequency: Varies

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants
The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Hist Auto: EDR Exclusive Historical Auto Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR Hist Cleaner: EDR Exclusive Historical Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS: Recovered Government Archive State Hazardous Waste Facilities List

The EDR Recovered Government Archive State Hazardous Waste database provides a list of SHWS incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Conservation in New York.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 12/30/2013
Number of Days to Update: 182

Source: Department of Environmental Conservation
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Conservation in New York.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/10/2014
Number of Days to Update: 193

Source: Department of Environmental Conservation
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

COUNTY RECORDS

CORTLAND COUNTY:

AST - CORTLAND: Cortland County Storage Tank Listing
A listing of aboveground storage tank sites located in Cortland County.

Date of Government Version: 08/20/2019
Date Data Arrived at EDR: 08/20/2019
Date Made Active in Reports: 10/16/2019
Number of Days to Update: 57

Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 04/16/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Quarterly

UST - CORTLAND: Cortland County Storage Tank Listing
A listing of underground storage tank sites located in Cortland County.

Date of Government Version: 08/20/2019
Date Data Arrived at EDR: 08/20/2019
Date Made Active in Reports: 10/16/2019
Number of Days to Update: 57

Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 04/16/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Quarterly

NASSAU COUNTY:

AST - NASSAU: Registered Tank Database
A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 11/27/2023
Date Data Arrived at EDR: 11/28/2023
Date Made Active in Reports: 02/06/2024
Number of Days to Update: 70

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 04/16/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: No Update Planned

AST NCFM: Storage Tank Database
A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 04/16/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Varies

TANKS NASSAU: Registered Tank Database in Nassau County
A listing of facilities in Nassau County with storage tanks.

Date of Government Version: 11/27/2023
Date Data Arrived at EDR: 11/28/2023
Date Made Active in Reports: 02/06/2024
Number of Days to Update: 70

Source: Nassau County Department of Health
Telephone: 516-227-9691
Last EDR Contact: 04/16/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: No Update Planned

UST - NASSAU: Registered Tank Database
A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 11/27/2023
Date Data Arrived at EDR: 11/28/2023
Date Made Active in Reports: 02/06/2024
Number of Days to Update: 70

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 04/16/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: No Update Planned

UST NCFM: Storage Tank Database
A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 04/16/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Varies

ROCKLAND COUNTY:

AST - ROCKLAND: Petroleum Bulk Storage Database
A listing of aboveground storage tank sites located in Rockland County. Rockland County?s Petroleum Bulk Storage (PBS) program is no longer in service. All related operations/duties are now wholly overseen by the New York State Dept. of Environmental Conservation (NYSDEC).

Date of Government Version: 02/02/2017
Date Data Arrived at EDR: 03/17/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 189

Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 05/21/2025
Next Scheduled EDR Contact: 09/08/2025
Data Release Frequency: No Update Planned

UST - ROCKLAND: Petroleum Bulk Storage Database
A listing of underground storage tank sites located in Rockland County. Rockland County?s Petroleum Bulk Storage (PBS) program is no longer in service. All related operations/duties are now wholly overseen by the New York State Dept. of Environmental Conservation (NYSDEC).

Date of Government Version: 02/02/2017
Date Data Arrived at EDR: 03/17/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 189

Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 05/21/2025
Next Scheduled EDR Contact: 09/08/2025
Data Release Frequency: No Update Planned

SUFFOLK COUNTY:

AST - SUFFOLK: Storage Tank Database
A listing of aboveground storage tank sites located in Suffolk County.

Date of Government Version: 06/28/2018
Date Data Arrived at EDR: 12/06/2018
Date Made Active in Reports: 02/07/2019
Number of Days to Update: 63

Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 04/16/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: No Update Planned

TANKS SUFFOLK: Storage Tank Database
This county is not included in the state?s database. These are facilities that have no tank information in the storage tank database.

Date of Government Version: 06/28/2018
Date Data Arrived at EDR: 02/05/2019
Date Made Active in Reports: 03/08/2019
Number of Days to Update: 31

Source: Department of Health Services
Telephone: 631-854-2516
Last EDR Contact: 04/16/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Varies

UST - SUFFOLK: Storage Tank Database
A listing of underground storage tank sites located in Suffolk County.

Date of Government Version: 06/28/2018
Date Data Arrived at EDR: 12/06/2018
Date Made Active in Reports: 02/07/2019
Number of Days to Update: 63

Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 04/16/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: No Update Planned

WESTCHESTER COUNTY:

AST - WESTCHESTER: Listing of Storage Tanks
A listing of aboveground storage tank sites located in Westchester County.

Date of Government Version: 02/04/2025
Date Data Arrived at EDR: 02/14/2025
Date Made Active in Reports: 05/05/2025
Number of Days to Update: 80

Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 04/22/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Semi-Annually

UST - WESTCHESTER: Listing of Storage Tanks
A listing of underground storage tank sites located in Westchester County.

Date of Government Version: 02/04/2025
Date Data Arrived at EDR: 02/14/2025
Date Made Active in Reports: 05/05/2025
Number of Days to Update: 80

Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 04/22/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Semi-Annually

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data
Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 02/02/2025
Date Data Arrived at EDR: 02/04/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 79

Source: Department of Energy & Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 05/06/2025
Next Scheduled EDR Contact: 08/18/2025
Data Release Frequency: No Update Planned

NJ MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 12/31/2018
Date Data Arrived at EDR: 04/10/2019
Date Made Active in Reports: 05/16/2019
Number of Days to Update: 36

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 03/27/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Annually

PA MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 06/30/2018
Date Data Arrived at EDR: 07/19/2019
Date Made Active in Reports: 09/10/2019
Number of Days to Update: 53

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 04/03/2025
Next Scheduled EDR Contact: 07/21/2025
Data Release Frequency: Annually

RI MANIFEST: Manifest information
Hazardous waste manifest information

Date of Government Version: 12/31/2020
Date Data Arrived at EDR: 11/30/2021
Date Made Active in Reports: 02/18/2022
Number of Days to Update: 80

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 05/07/2025
Next Scheduled EDR Contact: 08/25/2025
Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data
Hazardous waste manifest information.

Date of Government Version: 10/28/2019
Date Data Arrived at EDR: 10/29/2019
Date Made Active in Reports: 01/09/2020
Number of Days to Update: 72

Source: Department of Environmental Conservation
Telephone: 802-241-3443
Last EDR Contact: 04/03/2025
Next Scheduled EDR Contact: 07/21/2025
Data Release Frequency: Annually

WI MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 05/31/2018
Date Data Arrived at EDR: 06/19/2019
Date Made Active in Reports: 09/03/2019
Number of Days to Update: 76

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 05/28/2025
Next Scheduled EDR Contact: 09/15/2025
Data Release Frequency: Annually

Oil/Gas Pipelines
Source: Endeavor Business Media
Petroleum Bundle (Crude Oil, Refined Products, Petrochemicals, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)) N = Natural Gas Bundle (Natural Gas, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)). This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

Electric Power Transmission Line Data
Source: Endeavor Business Media
This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:
Source: American Hospital Association, Inc.
Telephone: 312-280-5991
The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing
Source: Centers for Medicare & Medicaid Services
Telephone: 410-786-3000
A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes
Source: National Institutes of Health
Telephone: 301-594-6248
Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Private Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on private school locations in the United States.
Daycare Centers: Day Care Providers
Source: Department of Health
Telephone: 212-676-2444

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.
Source: FEMA
Telephone: 877-336-2627
Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005, 2010 and 2015 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands
Source: Department of Environmental Conservation
Telephone: 518-402-8961

Current USGS 7.5 Minute Topographic Map
Source: U.S. Geological Survey

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK ®- PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

EAST ADAMS REDEVELOPMENT - PHASE 6 AREA
100 RADDISON COURT
SYRACUSE, NY 13202

TARGET PROPERTY COORDINATES

Latitude (North):	43.039903 - 43° 2' 23.65''
Longitude (West):	76.144788 - 76° 8' 41.24''
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	406747.6
UTM Y (Meters):	4765667.0
Elevation:	402 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	14115660 SYRACUSE WEST, NY
Version Date:	2019
East Map:	14115658 SYRACUSE EAST, NY
Version Date:	2019

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).

TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General West

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

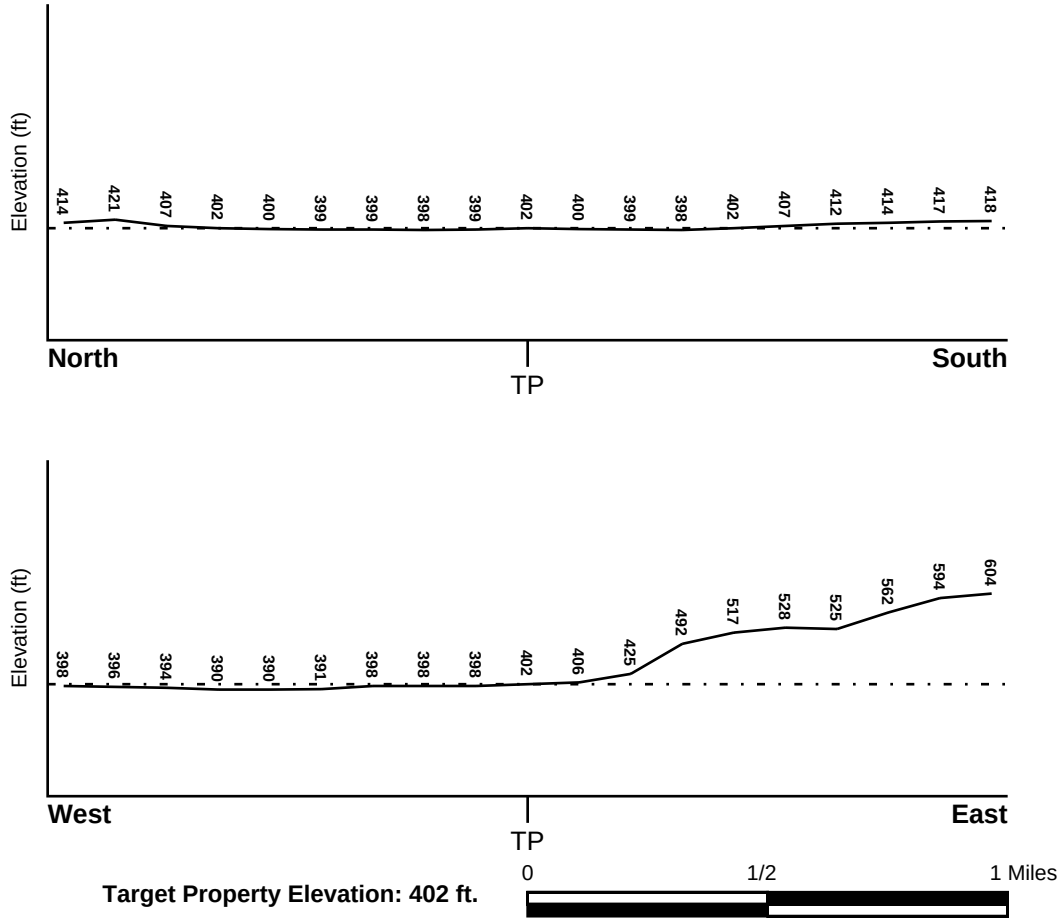

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Flood Plain Panel at Target Property	FEMA Source Type
3605950004E	FEMA Q3 Flood data

Additional Panels in search area:	FEMA Source Type
3605950003E	FEMA Q3 Flood data
3605950015E	FEMA Q3 Flood data

NATIONAL WETLAND INVENTORY

NWI Quad at Target Property	NWI Electronic Data Coverage
SYRACUSE WEST	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius:	1.25 miles
Status:	Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

MAP ID	LOCATION FROM TP	GENERAL DIRECTION GROUNDWATER FLOW
Not Reported		

* ©1996 Site−specific hydrogeological data gathered by CERCLIS Alerts, Inc., Bainbridge Island, WA. All rights reserved. All of the information and opinions presented are those of the cited EPA report(s), which were completed under a Comprehensive Environmental Response Compensation and Liability Information System (CERCLIS) investigation.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

Era:	Paleozoic
System:	Silurian
Series:	Upper Silurian (Cayugan)
Code:	S3 *(decoded above as Era, System & Series)*

GEOLOGIC AGE IDENTIFICATION

Category: Stratifed Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

SSURGO SOIL MAP - 8026566.2s

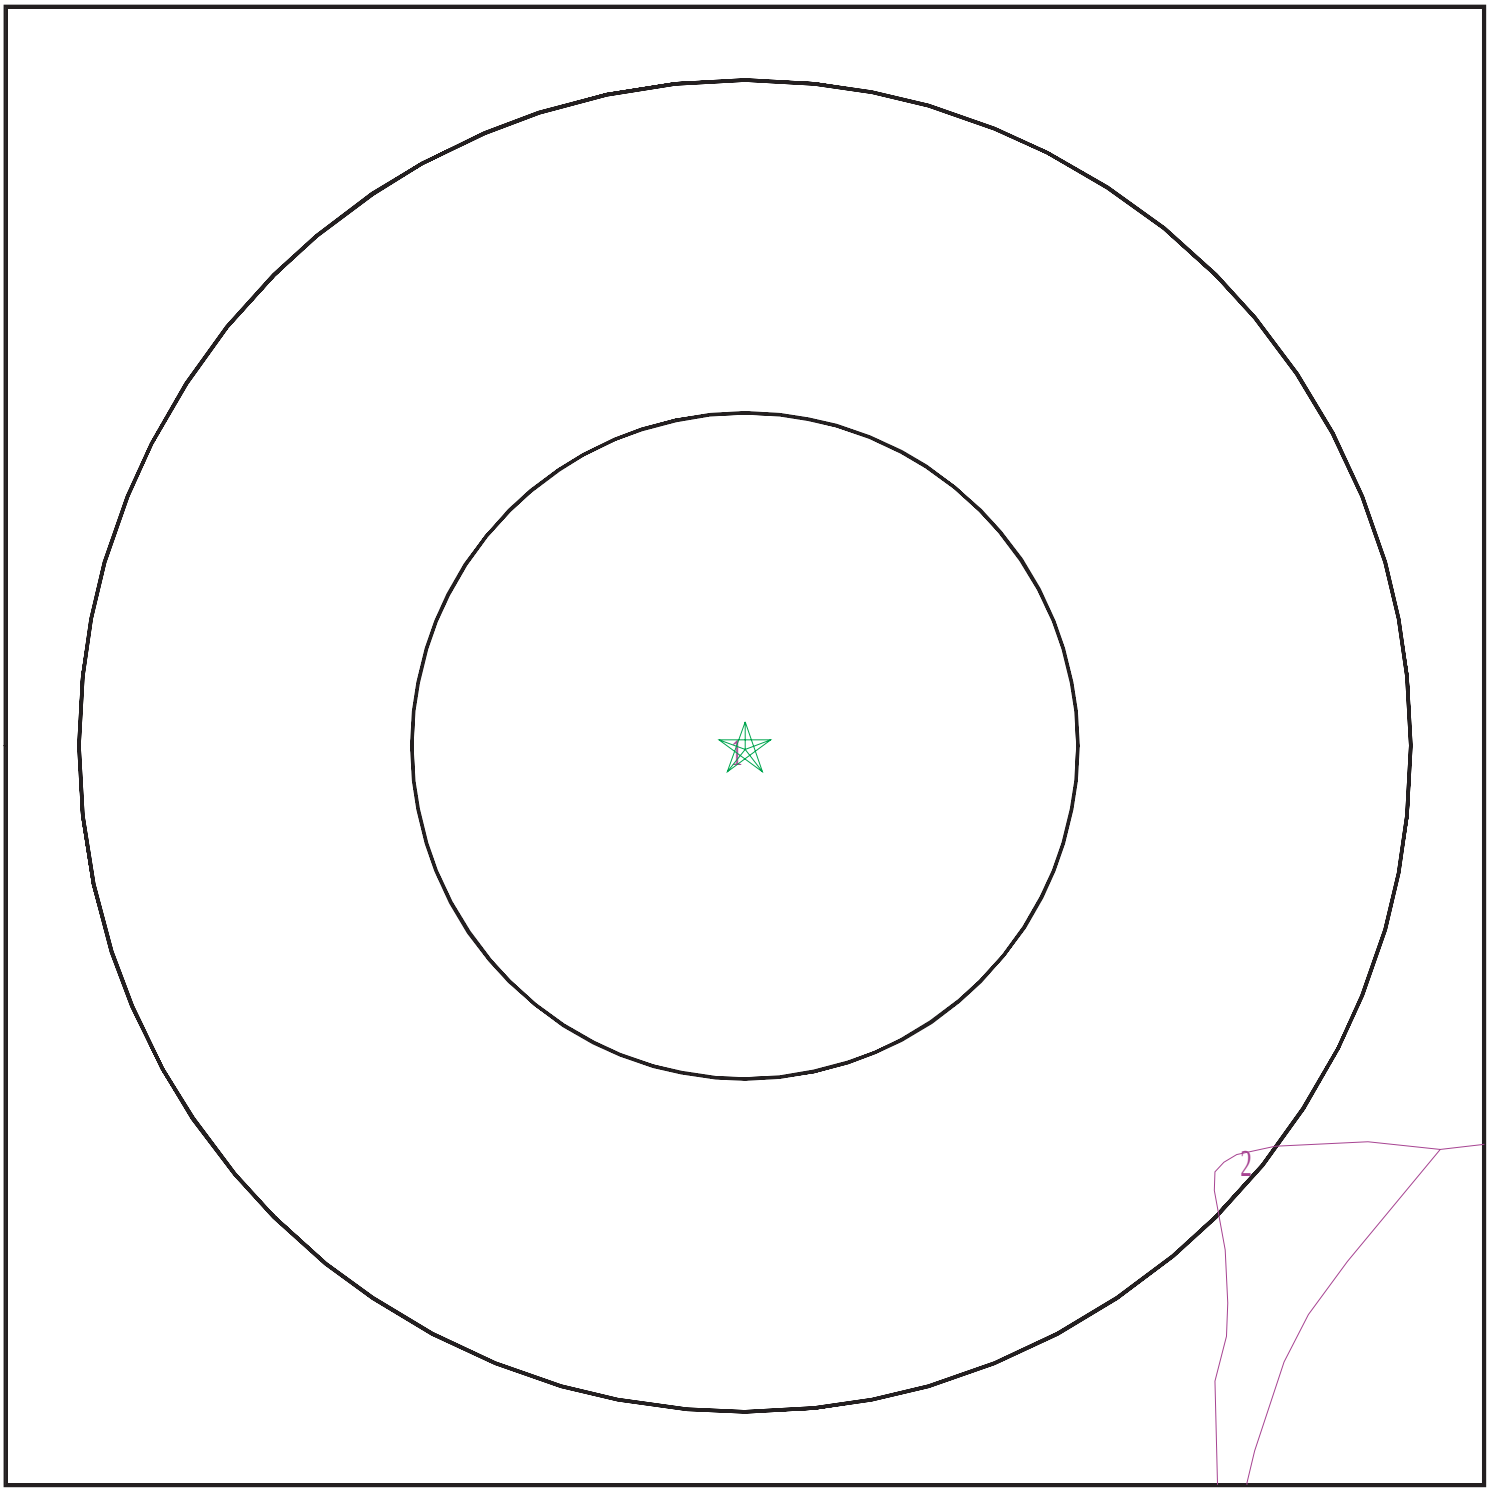

Target Property
SSURGO Soil
Water

0 1/16 1/8 1/4 Miles

N

SITE NAME:	East Adams Redevelopment - Phase 6 Area	CLIENT:	Langan
ADDRESS:	100 Raddison Court Syracuse NY 13202	CONTACT:	Lexi Haley
LAT/LONG:	43.039903 / 76.144788	INQUIRY #:	8026566.2s
		DATE:	June 23, 2025 11:26 am

Copyright © 2025 EDR, Inc. © 2015 TomTom Rel. 2015.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1

Soil Component Name: Urban land

Soil Surface Texture:
Hydrologic Group: Not reported

Soil Drainage Class:
Hydric Status: Unknown

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

No Layer Information available.

Soil Map ID: 2

Soil Component Name: Cazenovia

Soil Surface Texture: silt loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Moderately well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 92 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
	Boundary			Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil		
1	0 inches	11 inches	silt loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 1.4 Min: 0.42	Max: 8.4 Min: 6.6
2	11 inches	35 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 1.4 Min: 0.42	Max: 8.4 Min: 6.6
3	35 inches	59 inches	gravelly silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 1.4 Min: 0.42	Max: 8.4 Min: 6.6

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

DATABASE	SEARCH DISTANCE (miles)
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 0.001 miles
State Database	1.000

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
A1	USGS40000868997	0 - 1/8 Mile East
A2	USGS40000869022	1/8 - 1/4 Mile ENE
3	USGS40000868922	1/8 - 1/4 Mile SSW
B4	USGS40000869128	1/8 - 1/4 Mile NNW
B5	USGS40000869129	1/8 - 1/4 Mile NNW

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
6	USGS40000869138	1/8 - 1/4 Mile NNE
7	USGS40000868998	1/8 - 1/4 Mile West
8	USGS40000868887	1/8 - 1/4 Mile SSE
9	USGS40000869100	1/4 - 1/2 Mile NE
10	USGS40000869054	1/4 - 1/2 Mile WNW
B11	USGS40000869167	1/4 - 1/2 Mile NNW
12	USGS40000869010	1/4 - 1/2 Mile East
C13	USGS40000869066	1/4 - 1/2 Mile ENE
C14	USGS40000869078	1/4 - 1/2 Mile ENE
D15	USGS40000868833	1/4 - 1/2 Mile SSE
16	USGS40000869194	1/4 - 1/2 Mile NNE
E17	USGS40000869182	1/4 - 1/2 Mile NNW
18	USGS40000869166	1/4 - 1/2 Mile NE
F19	USGS40000869139	1/4 - 1/2 Mile NW
D20	USGS40000868806	1/4 - 1/2 Mile South
E21	USGS40000869183	1/4 - 1/2 Mile NW
D22	USGS40000868805	1/4 - 1/2 Mile SSE
F23	USGS40000869168	1/4 - 1/2 Mile NW
24	USGS40000869218	1/4 - 1/2 Mile NNW
25	USGS40000869228	1/4 - 1/2 Mile North
F26	USGS40000869169	1/4 - 1/2 Mile NW
27	USGS40000869165	1/4 - 1/2 Mile NE
G28	USGS40000869205	1/4 - 1/2 Mile NW
G29	USGS40000869246	1/4 - 1/2 Mile NNW
G30	USGS40000869206	1/4 - 1/2 Mile NW
31	USGS40000869260	1/4 - 1/2 Mile NNW
H32	USGS40000869170	1/4 - 1/2 Mile NW
H33	USGS40000869154	1/4 - 1/2 Mile WNW
H34	USGS40000869140	1/4 - 1/2 Mile WNW
G35	USGS40000869229	1/4 - 1/2 Mile NW
I36	USGS40000869204	1/4 - 1/2 Mile NE
37	USGS40000869219	1/4 - 1/2 Mile NW
J38	USGS40000868967	1/4 - 1/2 Mile West
I39	USGS40000869203	1/4 - 1/2 Mile NE
K40	USGS40000868795	1/4 - 1/2 Mile SE
41	USGS40000869282	1/4 - 1/2 Mile NNE
L42	USGS40000869120	1/4 - 1/2 Mile WNW
43	USGS40000868777	1/4 - 1/2 Mile SW
K44	USGS40000868776	1/4 - 1/2 Mile SE
L45	USGS40000869110	1/4 - 1/2 Mile WNW
M46	USGS40000869337	1/2 - 1 Mile North
M47	USGS40000869336	1/2 - 1 Mile North
M48	USGS40000869335	1/2 - 1 Mile NNE
J49	USGS40000868946	1/2 - 1 Mile WSW
N50	USGS40000869370	1/2 - 1 Mile North
51	USGS40000869321	1/2 - 1 Mile NE
N52	USGS40000869396	1/2 - 1 Mile North
53	USGS40000869409	1/2 - 1 Mile North
O54	USGS40000869207	1/2 - 1 Mile WNW
55	USGS40000868757	1/2 - 1 Mile SW
56	USGS40000869295	1/2 - 1 Mile NW
Q59	USGS40000869410	1/2 - 1 Mile NNW

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
Q60	USGS40000869423	1/2 - 1 Mile NNW
62	USGS40000869397	1/2 - 1 Mile NNW
O63	USGS40000869230	1/2 - 1 Mile WNW
64	USGS40000869208	1/2 - 1 Mile WNW
R65	USGS40000869310	1/2 - 1 Mile NW
66	USGS40000869452	1/2 - 1 Mile NNE
R67	USGS40000869283	1/2 - 1 Mile NW
68	USGS40000869408	1/2 - 1 Mile NNE
S69	USGS40000869270	1/2 - 1 Mile NW
70	USGS40000869460	1/2 - 1 Mile NNW
T71	USGS40000869474	1/2 - 1 Mile North
72	USGS40000868711	1/2 - 1 Mile SW
73	USGS40000869461	1/2 - 1 Mile NNW
S74	USGS40000869311	1/2 - 1 Mile NW
U75	USGS40000869424	1/2 - 1 Mile NNW
T76	USGS40000869550	1/2 - 1 Mile North
V77	USGS40000869488	1/2 - 1 Mile NNE
78	USGS40000869209	1/2 - 1 Mile WNW
79	USGS40000869533	1/2 - 1 Mile North
U80	USGS40000869462	1/2 - 1 Mile NNW
U81	USGS40000869437	1/2 - 1 Mile NW
W82	USGS40000869534	1/2 - 1 Mile NNW
83	USGS40000868690	1/2 - 1 Mile SW
X84	USGS40000869501	1/2 - 1 Mile NNW
V85	USGS40000869517	1/2 - 1 Mile NNE
X86	USGS40000869502	1/2 - 1 Mile NNW
W87	USGS40000869535	1/2 - 1 Mile NNW
88	USGS40000869377	1/2 - 1 Mile NW
89	USGS40000869565	1/2 - 1 Mile North
W90	USGS40000869549	1/2 - 1 Mile North
Y91	USGS40000869489	1/2 - 1 Mile NNW
Y92	USGS40000869503	1/2 - 1 Mile NNW
93	USGS40000869453	1/2 - 1 Mile NW
94	USGS40000869566	1/2 - 1 Mile NNW
95	USGS40000869516	1/2 - 1 Mile NNE
96	USGS40000868550	1/2 - 1 Mile SSE

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
No PWS System Found		

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
P57	NYWS50000072550	1/2 - 1 Mile NW

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
P58	NYWS50000072549	1/2 - 1 Mile NW
P61	NYWS50000072462	1/2 - 1 Mile NW

PHYSICAL SETTING SOURCE MAP - 8026566.2s

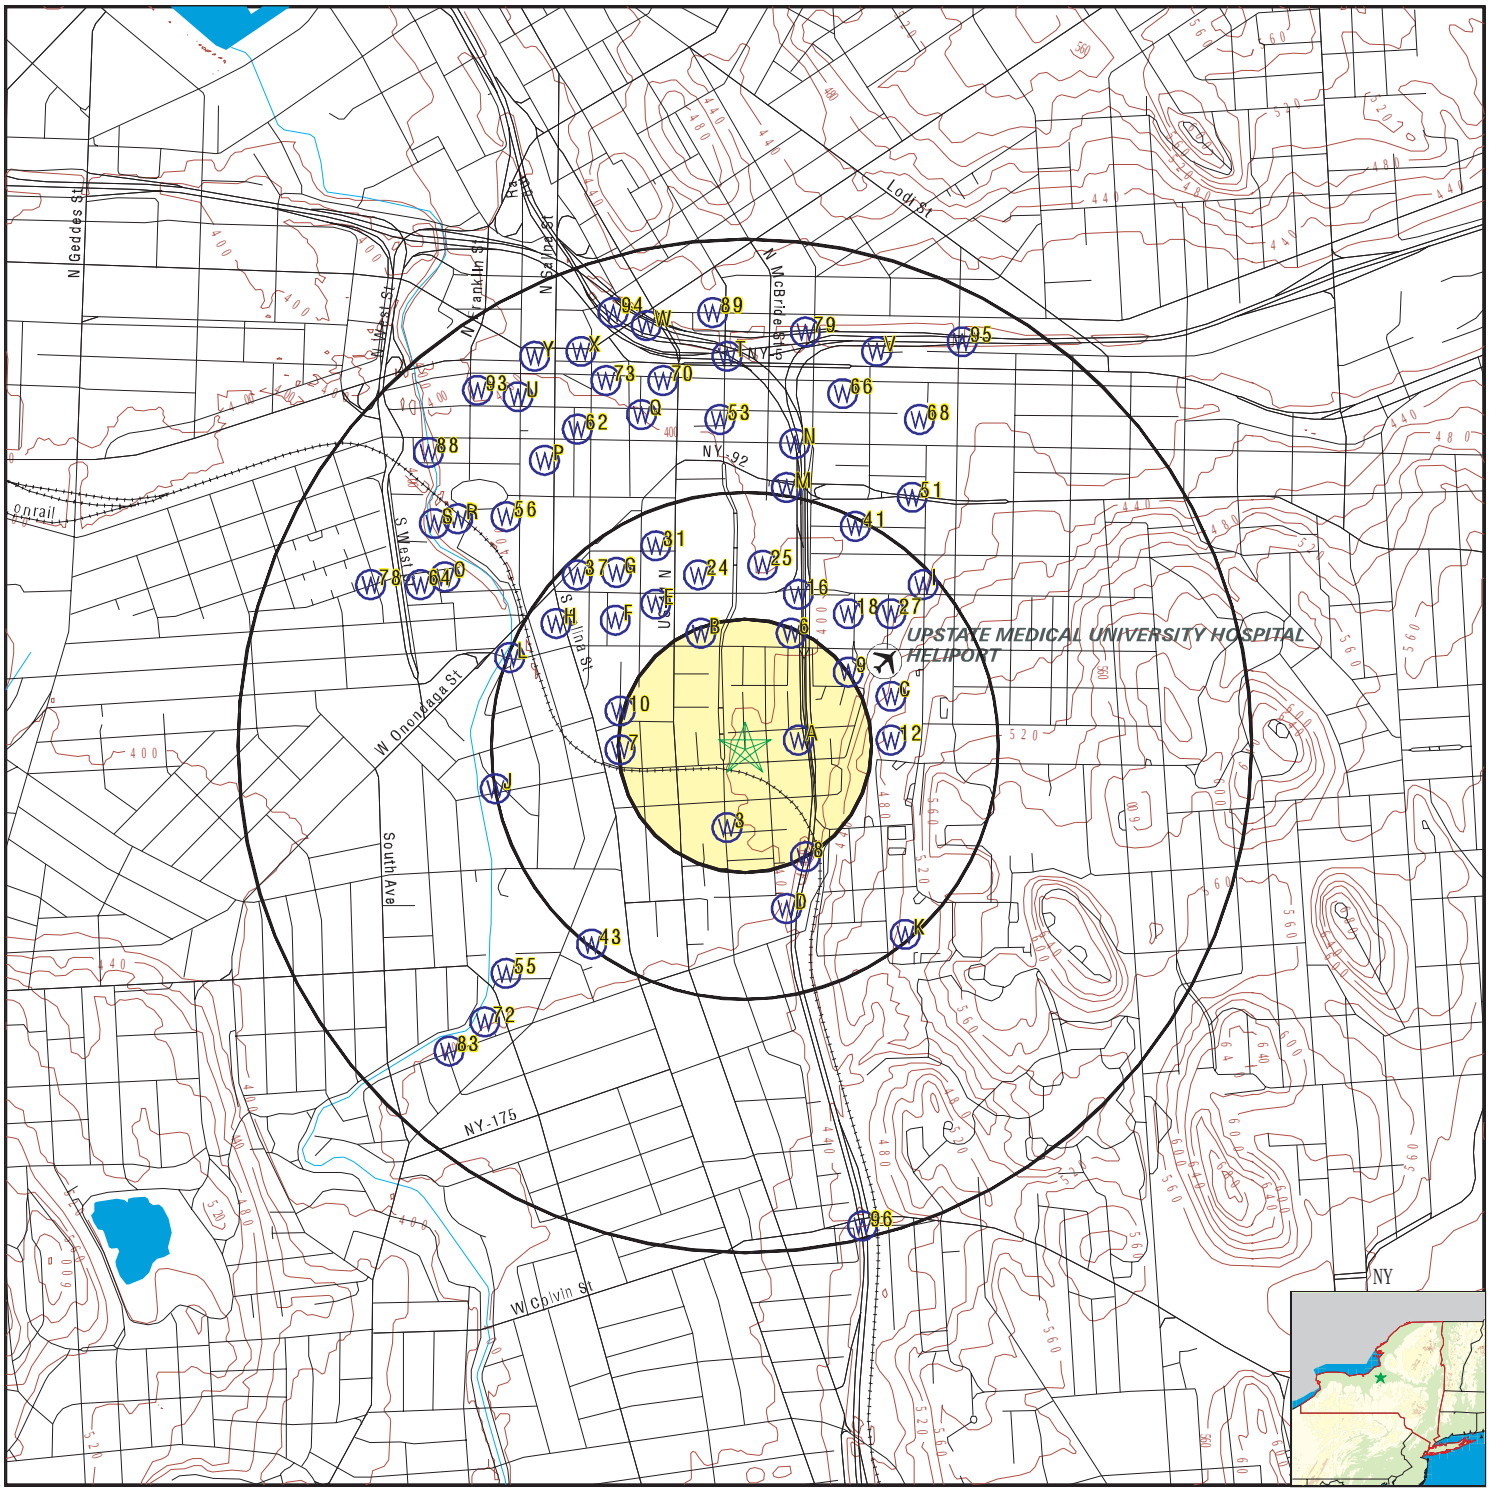

- County Boundary
- Major Roads
- Contour Lines
- Airports
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons
- Groundwater Flow Direction
- GI Indeterminate Groundwater Flow at Location
- GV Groundwater Flow Varies at Location
- HD Closest Hydrogeological Data
- Oil, gas or related wells

SITE NAME:	East Adams Redevelopment - Phase 6 Area	CLIENT:	Langan
ADDRESS:	100 Raddison Court Syracuse NY 13202	CONTACT:	Lexi Haley
LAT/LONG:	43.039903 / 76.144788	INQUIRY #:	8026566.2s
		DATE:	June 23, 2025 11:26 am

Copyright © 2025 EDR, Inc. © 2015 TomTom Rel. 2015.

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

A1
East
0 - 1/8 Mile
Higher

FED USGS **USGS40000868997**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1687		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19630709
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	69	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1963-07-09
Feet below surface:	14.7	Feet to sea level:	Not Reported
Note:	Not Reported		

A2
ENE
1/8 - 1/4 Mile
Higher

FED USGS **USGS40000869022**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 553		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	75	Well Hole Depth Units:	ft

3
SSW
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000868922**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1686		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	195912
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	155	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

B4
NNW
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000869128**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 580		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	113	Well Hole Depth Units:	ft

B5
NNW
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000869129**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 581		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	101	Well Hole Depth Units:	ft

6
NNE
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000869138**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 554		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	63	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

7
West
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000868998**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1689		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610824
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	166.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-08-24
Feet below surface:	9.5	Feet to sea level:	Not Reported
Note:	Not Reported		

8
SSE
1/8 - 1/4 Mile
Higher

FED USGS **USGS40000868887**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 550		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	30	Well Hole Depth Units:	ft

9
NE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869100**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1699		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196809
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	20	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1968-09
Feet below surface:	11.3	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

10
WNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869054**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1067		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19860207
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	151	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1986-02-07
Feet below surface:	8.7	Feet to sea level:	Not Reported
Note:	Not Reported		

B11
NNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869167**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 579		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	115	Well Hole Depth Units:	ft

12
East
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869010**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1700		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	197010
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	61	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1970-10
Feet below surface:	5	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

C13
ENE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869066**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1698		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196708
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	58	Well Hole Depth Units:	ft

C14
ENE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869078**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 518		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	49	Well Hole Depth Units:	ft

D15
SSE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000868833**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 548		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	65	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

16
NNE **FED USGS** **USGS40000869194**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 552		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	81	Well Hole Depth Units:	ft

E17
NNW **FED USGS** **USGS40000869182**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1068		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19700729
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	109.6	Well Hole Depth Units:	ft

18
NE **FED USGS** **USGS40000869166**
1/4 - 1/2 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1693		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	197306
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	68	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1973-06
Feet below surface:	10	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

F19
NW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869139**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 578		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	122	Well Hole Depth Units:	ft

D20
South
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000868806**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1772		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	20000522
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	67	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	2000-05-22
Feet below surface:	7.6	Feet to sea level:	Not Reported
Note:	Not Reported		

E21
NW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869183**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 582		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	119	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

D22
SSE **FED USGS** **USGS40000868805**
1/4 - 1/2 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1517		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610327
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	55	Well Hole Depth Units:	ft

F23
NW **FED USGS** **USGS40000869168**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 577		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	102	Well Hole Depth Units:	ft

24
NNW **FED USGS** **USGS40000869218**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1678		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196301
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	101	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1963-01
Feet below surface:	27	Feet to sea level:	Not Reported
Note:	Not Reported		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

25
North
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869228**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1675		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19720309
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	112.7	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1972-03-09
Feet below surface:	15	Feet to sea level:	Not Reported
Note:	Not Reported		

F26
NW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869169**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1501		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19640228
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	140	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1964-02-28
Feet below surface:	20	Feet to sea level:	Not Reported
Note:	Not Reported		

27
NE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869165**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1697		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196708
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	51.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1967-08
Feet below surface:	8.5	Feet to sea level:	Not Reported
Note:	Not Reported		

G28
NW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869205**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1099		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19640217
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	140	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1964-02-17
Feet below surface:	19.0	Feet to sea level:	Not Reported
Note:	Not Reported		

G29
NNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869246**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1500		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19640206
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	140	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1964-02-06
Feet below surface:	5	Feet to sea level:	Not Reported
Note:	Not Reported		

G30
NW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869206**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1679		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140202
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19700114

Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	68.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1970-01-14
Feet below surface:	27	Feet to sea level:	Not Reported
Note:	Not Reported		

31
NNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869260**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1677		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19720418
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	114	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1972-04-18
Feet below surface:	43.7	Feet to sea level:	Not Reported
Note:	Not Reported		

H32
NW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869170**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 248	Type:	Well
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	Not Reported	Well Depth:	56
Well Depth Units:	ft	Well Hole Depth:	Not Reported
Well Hole Depth Units:	Not Reported		

H33
WNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869154**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 246	Type:	Well
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	65	Well Depth Units:	ft

Well Hole Depth:	Not Reported	Well Hole Depth Units:	Not Reported

---

H34
WNW **FED USGS** **USGS40000869140**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 245	Type:	Well
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	Not Reported	Well Depth:	36
Well Depth Units:	ft	Well Hole Depth:	Not Reported
Well Hole Depth Units:	Not Reported		

G35
NW **FED USGS** **USGS40000869229**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1098		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19640210
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	160	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1964-02-10
Feet below surface:	16.0	Feet to sea level:	Not Reported
Note:	Not Reported		

I36
NE **FED USGS** **USGS40000869204**
1/4 - 1/2 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1633		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	1977
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	42.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1977

Feet below surface:	21.1	Feet to sea level:	Not Reported
Note:	Not Reported		

37
NW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869219**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 13	Type:	Well
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	Not Reported	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	Not Reported
Well Hole Depth Units:	Not Reported		

J38
West
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000868967**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1073		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19790316
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	72	Well Hole Depth Units:	ft

I39
NE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869203**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1695		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196910
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	42	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1969-10
Feet below surface:	19	Feet to sea level:	Not Reported
Note:	Not Reported		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

K40
SE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000868795**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1753		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	1962
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	129.5	Well Hole Depth Units:	ft

41
NNE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000869282**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1696		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196910
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	80	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1969-10
Feet below surface:	16.7	Feet to sea level:	Not Reported
Note:	Not Reported		

L42
WNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869120**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1716		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19580721
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	91	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1958-07-21
Feet below surface:	25	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

43
SW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000868777**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1685		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19631015
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	87.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1963-10-15
Feet below surface:	14	Feet to sea level:	Not Reported
Note:	Not Reported		

K44
SE
1/4 - 1/2 Mile
Higher

FED USGS **USGS40000868776**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1754		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	1962
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	62	Well Hole Depth Units:	ft

L45
WNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000869110**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 549		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	91	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

M46
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869337**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1513		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610603
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	110	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-06-03
Feet below surface:	21.4	Feet to sea level:	Not Reported
Note:	Not Reported		

M47
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869336**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 551		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	102	Well Hole Depth Units:	ft

M48
NNE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869335**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1523		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610407
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	127.3	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-04-07
Feet below surface:	28	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

J49
WSW
1/2 - 1 Mile
Lower

FED USGS **USGS40000868946**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1502		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19900308
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	70	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-03-08
Feet below surface:	13.9	Feet to sea level:	Not Reported
Note:	Not Reported		

N50
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869370**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1522		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610417
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	76	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-04-17
Feet below surface:	16	Feet to sea level:	Not Reported
Note:	Not Reported		

51
NE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869321**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1694		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196910
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	56	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1969-10
Feet below surface:	13.8	Feet to sea level:	Not Reported
Note:	Not Reported		

N52
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869396**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 555		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	74	Well Hole Depth Units:	ft

53
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869409**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1681		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19570716
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	32	Well Hole Depth Units:	ft

O54
WNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869207**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1868		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	20020920	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	70
Well Hole Depth Units:	ft		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

55
SW
1/2 - 1 Mile
Lower

FED USGS **USGS40000868757**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1072		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19980811
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	77	Well Hole Depth Units:	ft

56
NW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869295**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1690		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19710922
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	101.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1971-09-22
Feet below surface:	29	Feet to sea level:	Not Reported
Note:	Not Reported		

P57
NW
1/2 - 1 Mile
Lower

NY WELLS **NYWS50000072550**

WELLS:

DEC Well #:	OD02380	Well Depth (ft):	80
Bedrock Depth (ft):	-999	Groundwater Depth (ft):	30
Casing Depth (ft):	71	Casing 1 Diameter (in):	8
Casing 1 Length (ft):	64	Casing 2 Diameter (in):	Not Reported
Casing 2 Length (ft):	Not Reported	Screened Well:	Y
Screen Length (ft):	Not Reported	Avg Discharge Rate (gpm):	200
Well Purpose:	Not Reported	Driller Registration #:	NYRD10142
Report Date:	12-DEC-13	Drilling Start Date:	23-MAY-13
Drilling Completion Date:	24-MAY-13		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

P58
NW
1/2 - 1 Mile
Lower

NY WELLS **NYWS50000072549**

WELLS:

DEC Well #:	OD02379	Well Depth (ft):	76
Bedrock Depth (ft):	77	Groundwater Depth (ft):	30
Casing Depth (ft):	67	Casing 1 Diameter (in):	8
Casing 1 Length (ft):	60	Casing 2 Diameter (in):	Not Reported
Casing 2 Length (ft):	Not Reported	Screened Well:	Y
Screen Length (ft):	Not Reported	Avg Discharge Rate (gpm):	200
Well Purpose:	Not Reported	Driller Registration #:	NYRD10142
Report Date:	12-DEC-13	Drilling Start Date:	21-MAY-13
Drilling Completion Date:	22-MAY-13		

Q59
NNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869410**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1682		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19710709
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	48	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1971-07-09
Feet below surface:	12.5	Feet to sea level:	Not Reported
Note:	Not Reported		

Q60
NNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869423**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 571		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	40	Well Hole Depth Units:	ft

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

P61
NW
1/2 - 1 Mile
Lower

NY WELLS **NYWS50000072462**

WELLS:

DEC Well #:	OD02290	Well Depth (ft):	100
Bedrock Depth (ft):	95	Groundwater Depth (ft):	20
Casing Depth (ft):	84	Casing 1 Diameter (in):	6
Casing 1 Length (ft):	84	Casing 2 Diameter (in):	Not Reported
Casing 2 Length (ft):	Not Reported	Screened Well:	Y
Screen Length (ft):	Not Reported	Avg Discharge Rate (gpm):	100
Well Purpose:	Not Reported	Driller Registration #:	NYRD10142
Report Date:	11-APR-12	Drilling Start Date:	03-APR-12
Drilling Completion Date:	03-APR-12		

62
NNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869397**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1692		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	196812
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	40	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1968-12
Feet below surface:	22	Feet to sea level:	Not Reported
Note:	Not Reported		

O63
WNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869230**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1867		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	20020923	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	69
Well Hole Depth Units:	ft		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

64
WNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869208**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1777		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19950223
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	80	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1995-02-23
Feet below surface:	8	Feet to sea level:	Not Reported
Note:	Not Reported		

R65
NW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869310**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1866		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	20051101	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	70
Well Hole Depth Units:	ft		

66
NNE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869452**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1853	Type:	Well
Description:	Not Reported	HUC:	Not Reported
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	New York and New England carbonate-rock aquifers		
Formation Type:	Vernon Shale	Aquifer Type:	Confined multiple aquifer
Construction Date:	20060215	Well Depth:	410
Well Depth Units:	ft	Well Hole Depth:	410
Well Hole Depth Units:	ft		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

R67
NW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869283**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1854	Type:	Well
Description:	Not Reported	HUC:	Not Reported
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Unconfined single aquifer	Construction Date:	Not Reported
Well Depth:	101	Well Depth Units:	ft
Well Hole Depth:	101	Well Hole Depth Units:	ft

68
NNE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869408**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1688		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140202
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19690529
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	60	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1969-05-29
Feet below surface:	12.7	Feet to sea level:	Not Reported
Note:	Not Reported		

S69
NW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869270**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1865		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	20051118	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	101
Well Hole Depth Units:	ft		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

70
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869460**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 572		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	39	Well Hole Depth Units:	ft

T71
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869474**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1516		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610412
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	58	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-04-12
Feet below surface:	21	Feet to sea level:	Not Reported
Note:	Not Reported		

72
SW
1/2 - 1 Mile
Lower

FED USGS **USGS40000868711**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1070		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	20010326
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	61	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

73
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869461**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1680		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	26	Well Hole Depth Units:	ft

S74
NW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869311**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1864		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	20051122	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	71
Well Hole Depth Units:	ft		

U75
NNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869424**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1767		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19890910
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	47	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1989-09-10
Feet below surface:	22	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

T76
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869550**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 520		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	52	Well Hole Depth Units:	ft

V77
NNE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869488**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1518		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610510
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	72	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-05-10
Feet below surface:	32	Feet to sea level:	Not Reported
Note:	Not Reported		

78
WNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869209**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 250	Type:	Well
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	Not Reported	Well Depth:	132
Well Depth Units:	ft	Well Hole Depth:	Not Reported
Well Hole Depth Units:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

79
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869533**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 565		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	60	Well Hole Depth Units:	ft

U80
NNW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869462**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1529		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19700713
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	58	Well Hole Depth Units:	ft

U81
NW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869437**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 574		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	101	Well Hole Depth Units:	ft

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

W82
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869534**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 563		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	40	Well Hole Depth Units:	ft

83
SW
1/2 - 1 Mile
Higher

FED USGS **USGS40000868690**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1071		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	20010322
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	61	Well Hole Depth Units:	ft

X84
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869501**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1779		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19900403
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	29.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-04-03
Feet below surface:	12	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

V85
NNE **FED USGS** **USGS40000869517**
1/2 - 1 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1603		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19620702
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	70	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1962-07-02
Feet below surface:	31	Feet to sea level:	Not Reported
Note:	Not Reported		

X86
NNW **FED USGS** **USGS40000869502**
1/2 - 1 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 558		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	55	Well Hole Depth Units:	ft

W87
NNW **FED USGS** **USGS40000869535**
1/2 - 1 Mile
Higher

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1525		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19600420
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	42	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1960-04-20
Feet below surface:	21	Feet to sea level:	Not Reported
Note:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

88
NW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869377**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1869		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Sand and Gravel	Aquifer Type:	Not Reported
Construction Date:	20000914	Well Depth:	Not Reported
Well Depth Units:	Not Reported	Well Hole Depth:	75
Well Hole Depth Units:	ft		

89
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869565**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1631		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	1977
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	23	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1977
Feet below surface:	15.5	Feet to sea level:	Not Reported
Note:	Not Reported		

W90
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000869549**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 522		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	36	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

Y91
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869489**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 556		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	65	Well Hole Depth Units:	ft

Y92
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869503**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 557		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	55	Well Hole Depth Units:	ft

93
NW
1/2 - 1 Mile
Lower

FED USGS **USGS40000869453**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 573		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	100	Well Hole Depth Units:	ft

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

94
NNW
1/2 - 1 Mile
Higher

FED USGS **USGS40000869566**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1515		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19610424
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	35	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1961-04-24
Feet below surface:	12	Feet to sea level:	Not Reported
Note:	Not Reported		

95
NNE
1/2 - 1 Mile
Higher

FED USGS **USGS40000869516**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD1604		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19620628
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	64	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1962-06-28
Feet below surface:	31	Feet to sea level:	Not Reported
Note:	Not Reported		

96
SSE
1/2 - 1 Mile
Higher

FED USGS **USGS40000868550**

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	OD 547		
Type:	Well: Test hole not completed as a well		
Description:	Not Reported	HUC:	04140201
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	24	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS
RADON

AREA RADON INFORMATION

State Database: NY Radon

Radon Test Results

County	Town	Num Tests	Avg Result	Geo Mean	Max Result
ONONDAGA	CAMILLUS	980	11.38	6	188.3
ONONDAGA	CICERO	275	1.96	1.28	30.5
ONONDAGA	CLAY	328	2	1.19	30.4
ONONDAGA	DE WITT	754	10.01	3.76	346.7
ONONDAGA	ELBRIDGE	129	13.42	6.2	96.1
ONONDAGA	FABIUS	26	5.17	3.03	26.5
ONONDAGA	GEDDES	291	9.25	4.79	99.3
ONONDAGA	LAFAYETTE	105	7.39	4.25	95.6
ONONDAGA	LYSANDER	272	4.14	2.1	89.1
ONONDAGA	MANLIUS	1,442	11.4	5.03	341.8
ONONDAGA	MARCELLUS	251	5.91	3.39	98
ONONDAGA	ONONDAGA	294	10.8	5.9	89.4
ONONDAGA	OTISCO	21	7.32	3.64	40.1
ONONDAGA	POMPEY	105	6.84	4.7	35
ONONDAGA	SALINA	449	2.49	1.49	69.5
ONONDAGA	SKANEATELES	203	4.39	2.43	105.7
ONONDAGA	SPAFFORD	16	3.66	2.32	8.8
ONONDAGA	SYRACUSE	2,334	6.8	3.48	185.4
ONONDAGA	TULLY	140	18.29	8.48	165.2
ONONDAGA	VAN BUREN	119	6.68	2.5	70.1

Federal EPA Radon Zone for ONONDAGA County: 1

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for ONONDAGA COUNTY, NY

Number of sites tested: 476

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area	1.760 pCi/L	76%	21%	3%
Basement	3.000 pCi/L	62%	29%	9%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)
Source: United States Geologic Survey
EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Current USGS 7.5 Minute Topographic Map
Source: U.S. Geological Survey

HYDROLOGIC INFORMATION

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.
Source: FEMA
Telephone: 877-336-2627
Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005, 2010 and 2015 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands
Source: Department of Environmental Conservation
Telephone: 518-402-8961

HYDROGEOLOGIC INFORMATION

AQUIFLOW^{R} Information System
Source: EDR proprietary database of groundwater flow information
EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit
Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)
The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)
Telephone: 800-672-5559
SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Service, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)
This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

New York Public Water Wells
Source: New York Department of Health
Telephone: 518-458-6731

OTHER STATE DATABASE INFORMATION

Oil and Gas Well Database
Source: Department of Environmental Conservation
Telephone: 518-402-8072
These files contain records, in the database, of wells that have been drilled.

RADON

State Database: NY Radon
Source: Department of Health
Telephone: 518-402-7556
Radon Test Results

Area Radon Information
Source: USGS
Telephone: 703-356-4020
The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones
Source: EPA
Telephone: 703-356-4020
Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities
Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater
Source: Department of Commerce, National Oceanic and Atmospheric Administration

Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary faultlines, prepared in 1975 by the United State Geological Survey

PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

Appendix G Resumes of Environmental Professionals

Appendix G Resumes of Environmental Professionals

BRIAN GOCHENAUR, QEP

ASSOCIATE PRINCIPAL

ENVIRONMENTAL SCIENTIST

Mr. Gochenaur is an environmental project manager with 20 years of experience in environmental due diligence, site investigation and remediation, fuel oil storage tank investigation and removal, soil vapor intrusion assessments, in-situ remedial technology, spill closure, vapor barrier and sub-slab depressurization system design and construction, emergency response, environmental and geotechnical site investigations, and health and safety monitoring. He has extensive experience with the New York State Department of Environmental Conservation (NYSDEC) Brownfield Cleanup, Voluntary Cleanup and Spill Programs and New York City Department of Environmental Protection (NYCDEP) "E" Designated and New York City Voluntary Cleanup Program (BCP) sites. His areas of expertise include Phase I Environmental Site Assessments, Phase II Site Investigations, and environmental consulting and oversight on large scale construction projects.

EDUCATION

B.S., Environmental Science
University of Florida

PROFESSIONAL REGISTRATION

Qualified Environmental Professional (QEP) certified by the Institute of Professional Environmental Practice

40-Hour OSHA (HAZWOPER)

SELECTED PROJECTS

- 440 Washington Street, E-Designated services, New York, NY
- 3514 Surf Avenue, Tall Residential and Retail Building, Brooklyn, NY
- ARO 242 West 53, Tall Residential Building, New York, NY
- NY Aquarium Shark Exhibit, Soil Characterization and Excavation Oversight, Coney Island Neighborhood, Brooklyn, NY
- 60 West Street, Site Investigation and Redevelopment, Brooklyn, NY
- 535 4th Avenue, BCP Auto Repair Cleanup and Redevelopment, Brooklyn, NY
- 1525 Bedford Avenue, BCP Gas Station Cleanup and Redevelopment, Brooklyn, NY
- 220 Eleventh Avenue, Residential Building, New York, NY
- 432 Rodney Street, Residential Building, Brooklyn, NY
- 563 Sackett Street, Brooklyn, NY
- 362 West 125th Street, Residential Building, New York, NY
- Bedford Armory Redevelopment, Brooklyn, NY
- 268 West Street, BCP Redevelopment of Former Commercial and Industrial Site, New York, NY
- 110 125th Street, Soil Excavation and Remediation, New York, NY
- Former Roseland Ballroom Redevelopment, Soil Characterization and Excavation Oversight, New York, NY
- 42 Crosby Street, "E" Designated Site Investigation and Remediation, New York, NY
- New York School Construction Authority, Various Locations, In-House Environmental Consulting, Five Boroughs of New York City
- EZ Serve Portfolio, GE Capital, Various Phase II Site Investigations, FL, GA, LA, and MS
- Beth Elohim Child Daycare Center, Lead Based Paint Abatement, Brooklyn, NY
- Price Battery, Environmental Protection Agency (EPA) Lead Fallout Superfund Site, Hamburg, PA

- Clark Portfolio, GE Capital, Various Phase II Locations, MI, IL, ID, and OH
- Tops Plaza Portfolio, Prudential Real Estate Investors, Various Phase II Locations, NY
- Cingular Wireless Portfolio, Cingular Wireless, Various Locations Phase I and II Locations, WA
- Queens Center Mall Expansion, Remedial Oversight, Elmhurst, NY
- Soka Gakkai International-USA, Cultural Center, Brooklyn, NY
- 1752 Shore Parkway, Environmental Remediation, Brooklyn, NY
- Bedford Union Armory, NYS Brownfield Cleanup Program, Brooklyn, NY
- NYCEDC Manhattan Greenway – Harlem River, New York, NY
- 445 Gerard Avenue, Residential Building, Bronx, NY
- Towne Gardens North, Residential Building, Buffalo, NY

LAMEES ESMAIL, PE

PROJECT ENGINEER

ENVIRONMENTAL ENGINEERING

Ms. Esmail is a civil and environmental engineer with four years of experience supporting environmental oversight and remediation projects in New York City. She has performed environmental field work including preparing daily inspection reports, photo documentation of work, and reviewing contractor submittals. She currently performs site research, manages field oversight, reviews/approves contractor submittals, prepares reports, and is involved with remedial design, implementation and project management.

Prior to joining Langan, Ms. Esmail gained three years of experience supporting environmental permitting and erosion and sedimentation control primarily for linear overhead transmission line projects. Types of permits included state land disturbance approvals and Army Corps of Engineers Section 10 Pre-Construction Notifications. Ms. Esmail also has experience aiding with the siting of new substation properties, using ArcGIS and AutoCAD to compile data for potential sites.

EDUCATION

B.S., Civil Engineering (Environmental Concentration)
George Washington University

PROFESSIONAL REGISTRATION

Professional Engineer (PE) in NY

SELECTED PROJECTS

- Con Edison Partial Replacement of 345KV Feeders M51 & M52 Feasibility Study, New York, NY
- 220 Eleventh Avenue, Hudson Arts Building, New York, NY
- 50 Hudson Yards, Supertall Office Building, New York, NY
- 215 North 10th Street, Brooklyn, NY
- 320 West 135th Street, New York, NY
- 163 Varick Street, New York, NY
- 39 West 23rd Street, New York, NY
- 1 Huron Street, Brooklyn, NY
- Bedford Armory, Brooklyn, NY
- 1607 Surf Avenue, Brooklyn, NY
- 414 Gerard Avenue, Bronx, NY
- 445 Gerard Avenue, Bronx, NY
- 326-350 Rockaway Avenue, Brooklyn, NY
- 197-201 Canal Street, Staten Island, NY
- 475 Bay Street, Staten Island, NY
- Astoria Steel, Queens, NY
- 99 Hudson Boulevard, New York, NY
- 4650 Broadway, New York, NY
- 12-57 57th Street, Brooklyn, NY
- 805-825 Atlantic Avenue, Brooklyn, NY
- Various Phase I Environmental Site Assessments (ESAs) in NYC

SELECTED PUBLICATIONS, REPORTS, AND PRESENTATIONS

Esmail, L., “Transmission Line Erosion Control and Construction Specifications”, Duke Energy Progress Transmission Erosion and Sedimentation Control Seminar, Raleigh, NC, November 2016.

KAITLYN GIOIA

SENIOR STAFF SCIENTIST

ENVIRONMENTAL ENGINEERING

Ms. Gioia is an Environmental Scientist with the New York City team. Ms. Gioia graduated in 2016 from Adelphi University with a B.A. in Environmental Studies. Ms. Gioia's experiences include project management, leading field work, exposure to an assortment of environmental pollutants, remedial action procedures, & Phase I and Phase II Environmental Assessments. Ms. Gioia has performed Asbestos Hazard and Emergency Response Act (AHERA) inspections and evaluations in schools and State Pollutant Discharge Elimination System (SPDES) sampling for power plants and commercial facilities.

SELECTED PROJECTS

- 80-100 Flatbush Avenue, Brooklyn, NY
- 250 Water Street, New York, NY
- 35-01 & 35-09 Northern Boulevard, Long Island City, NY
- 23-15 44th Road, Long Island City, NY
- South Randalls Due Diligence, New York, NY
- 595-647 Smith Street, Brooklyn, NY
- Willets Point Redevelopment, Flushing, NY
- President Street Properties, Brooklyn, NY
- 475 Bay Street, Staten Island, NY
- Confidential Project, Queens, NY
- 137 Kings Highway, Brooklyn, NY
- 111 Willow Avenue, Bronx, NY
- 560 Degraw Street, Brooklyn, NY
- 122 Fifth Avenue, New York, NY
- NYCDDC/NYPD 116th Precinct, Rosedale, NY
- Insurance Claim Oversight, White Plains, NY*
- Subrogation Potential Investigation, Lindenhurst, NY*
- Brookhaven National Lab, Brookhaven, NY*
- Far Rockaway Vault Sampling, Far Rockaway, NY*
- East Islip School District AHERA Inspection, East Islip, NY*
- UPRS SPDES Sampling, Uniondale, NY*
- 550 Stewart Avenue Phase I and II, Garden City, NY*
- Riverhead to Canal Cable Expansion, Riverhead, NY*
- Noise Dosimetry Study, Queens, NY*
- School District Lead in Water Sampling, Yonkers, Kings Park, and Baldwin, NY*
- Potable Water Sampling, New York, NY*
- DCF Remediation Oversight, Malverne, West Hempstead, and Port Washington, NY*
- AOP Pilot Testing, Garden City Park, Franklin Square, and Port Washington, NY*

EDUCATION

B.A., Environmental Studies
Adelphi University

PROFESSIONAL REGISTRATION

OSHA 40-Hour

OSHA10-Hour

NYS Department of Labor, Asbestos Inspector License

USEPA Lead Based Paint Inspector License

NYSDEC Class A/B Operator of Underground Storage Tank Systems

NYSDEC 4-Hour Erosion and Sediment Control Contractor Training 2021

**Projects represent experience with a previous firm*

SELECTED PUBLICATIONS, REPORTS, AND PRESENTATIONS

"Fecundity and Embryonic Development of Spiny Dogfish in the Northwest Atlantic Ocean" Transactions of the American Fisheries Society 2019.

Dutton J., Fisher NS., Gioia KA., Madigan DJ., "Tissue Distribution of Mercury in Female Spiny Dogfish (Squalus Acanthias)" Society of Environmental Toxicology and Chemistry South-Central Regional Meeting 2016, Fort Worth, TX.

Dutton J., Fisher NS., Gioia KA., Madigan DJ., "Maternal Transfer of Mercury in Spiny Dogfish" 12th International Congress on The Biology of Fish 2016, San Marcos, TX.

Dutton J., Fisher NS., Gioia KA., Madigan DJ., "Mercury Bioaccumulation and Maternal Transfer in Spiny Dogfish (Squalus Acanthias)" 33rd Annual Meeting of The American Elasmobranch Society/Joint Meeting of Ichthyologists and Herpetologists 2017, Austin, TX.

ADITI SINGH

EIT

Staff Engineer
Environmental Engineering

Education

- B.S., Chemical Engineering, University of Illinois

Professional Registration

- Engineer-in-Training (EIT)

Certifications

- 40-Hour OSHA HAZWOPER
- 10-Hour OSHA Construction

Ms. Singh is a staff engineer with Langan's environmental engineering group. She graduated from the University of Illinois at Urbana-Champaign in with a degree in chemical engineering. Aditi is also currently pursuing a master's degree in environmental engineering. Prior to joining Langan, she was a process engineer at a water filtration manufacturing facility. At Langan, her responsibilities include Phase I and II Environmental Site Assessments (ESA), soil and groundwater sampling, evaluation, and report processing.

Selected Projects

- Phase I ESA, Confidential Client, Atlanta, GA
- Phase I ESA, Confidential Client, Aurora IL
- Phase I ESA, Confidential Client, Joliet, IL
- Phase I ESA, Confidential Client, Kokomo, IN
- Phase I ESA, Confidential Client, Scott City, MO
- Phase I ESA, Confidential Client, Albany, NY
- Phase II ESA, Confidential Client, Channahon, IL
- Phase II ESA, Confidential Client, Kansas City, MO
- Phase II ESA, Confidential Client, Ottawa, IL
- Phase II ESA, Confidential Client, Maryville, MO
- Air Monitoring, Confidential Client, Aurora, IL
- Remediation Oversight, Confidential Client, Channahon, IL

ASHLIN CAELWAERTS

EIT

Staff Engineer
Environmental Engineering

Education

- B.S., Environmental Engineering, University of Wisconsin-Platteville

Professional Registration

- Engineer-in-Training (EIT) in IL

Certifications

- 40-Hour HAZWOPER
- 10-Hour OSHA

Affiliations

- American Society of Civil Engineers
- Professional Women in Construction

Ms. Caelwaerts is a staff engineer with Langan's environmental group. She graduated from the University of Wisconsin-Platteville in 2021 with a degree in environmental engineering, and she has previous civil engineering experience in both Illinois and Wisconsin. At Langan her responsibilities include Phase I and II Environmental Site Assessments (ESAs), soil and groundwater sampling, evaluation, and report processing.

Selected Projects

- 312 Carpenter, Chicago, IL
- 1115 W. Fulton Market, Chicago, IL
- Hollywood Casino, Joliet, IL
- Millsdale Road, Joliet , IL
- Digital Realty - Northlake, IL Survey, Melrose Park, IL
- Hollywodo Casino, Aurora, IL
- 1100 Kirk St., Elk Grove Village, IL
- Earthrise - Multiple Will County Sites, Manhattan, IL
- New Leaf Energy, Multiple Sites, IL
- Bilter Road & N. Eola Road, Aurora, IL
- 1824 W 59th Street, Chicago, IL
- 821 Bluff Road, Romeoville, IL
- Stantec, Country Club Hills, IL
- Gowanus Canal Northside, Brooklyn, NY
- 175-225 3rd Street, Brooklyn, NY
- President Street Properties, Brooklyn, NY
- 514 Union Street, Brooklyn, NY
- 335 Bond Street, Brooklyn, NY
- 46-15 Kissena Boulevard, Flushing, NY
- Stantec, Pewaukee, WI
- Phase I Due Diligence, Atlanta, GA
- Cyber Car Washes, Las Vegas, NV; Henderson, NV; McMinnville, OR;
- 1350 Technology Way, Morristown, TN
- Breckenridge - LNG, Breckenridge, MN
- Envoy Solutions - EHS Compliance, Blacksburg, SC
- Tenaska MISO Battery Storage, Charter Township of Brownstown, MI
- Saxum Cold/Frozen Storage Warehouse, Romulus, MI

OLIVIA MILLER

STAFF GEOLOGIST

ENVIRONMENTAL ENGINEERING

Ms. Miller is a staff geologist with over 4 years of experience in Phase I ESA's and due diligence. She has worked on various projects throughout Long Island, New York City, New Jersey, Connecticut, and Massachusetts. Ms. Miller is responsible for providing site exploration activities including, contaminated site investigation and remediation work; soil and groundwater sampling; vapor intrusion investigation; remedial investigation, design, implementation, and monitoring; pilot tests; data management, processing, and evaluation; and report preparation.

SELECTED PROJECTS

- Vital Brooklyn, Brooklyn, NY
- 95 Lombardy Street, Brooklyn, NY
- 98 Anthony Street, Brooklyn, NY
- 250 Water Street, New York, NY
- 305 Nevins Street, Brooklyn, NY
- 36-24 12th Street, Astoria, NY
- 111 Washington Street, New York, NY
- President Street Properties, Brooklyn, NY
- 353-361 Bedford Avenue, Brooklyn, NY
- Bronx Point, BCP Services, Bronx, NY
- Willets Point Redevelopment, Flushing, NY
- NYPD 116th Precinct, Rosedale, NY
- 8 Carlisle Street, New York, NY
- Jamaica Hospital Medical Center, Jamaica, NY
- 77-57 Vleigh Pl., BCP Services, Flushing, NY*
- LaGuardia Airport, Queens, NY*
- Former Darby Drugs, 80-100 Banks Avenue, Rockville Centre, NY*
- Georgica Ventures, East Hampton, NY*
- Residential fuel spill, Nesconset, NY*
- Alphamed Bottles, Central Islip, NY*

EDUCATION

B.S., Geology
Stony Brook University

PROFESSIONAL REGISTRATION

OSHA 40-Hour HAZWOPER

OSHA 10-Hour

Construction Safety and Health

NYSDEC 4-Hour Erosion and Sediment Control Training

AFFILIATIONS

Long Island Association of Professional Geologists (LIAPG) – Board Member

**Projects represent experience with a previous firm*

BRIAN GOCHENAUR, QEP

ASSOCIATE PRINCIPAL

ENVIRONMENTAL SCIENTIST

Mr. Gochenaur is an environmental project manager with 20 years of experience in environmental due diligence, site investigation and remediation, fuel oil storage tank investigation and removal, soil vapor intrusion assessments, in-situ remedial technology, spill closure, vapor barrier and sub-slab depressurization system design and construction, emergency response, environmental and geotechnical site investigations, and health and safety monitoring. He has extensive experience with the New York State Department of Environmental Conservation (NYSDEC) Brownfield Cleanup, Voluntary Cleanup and Spill Programs and New York City Department of Environmental Protection (NYCDEP) "E" Designated and New York City Voluntary Cleanup Program (BCP) sites. His areas of expertise include Phase I Environmental Site Assessments, Phase II Site Investigations, and environmental consulting and oversight on large scale construction projects.

EDUCATION

B.S., Environmental Science
University of Florida

PROFESSIONAL REGISTRATION

Qualified Environmental Professional (QEP) certified by the Institute of Professional Environmental Practice

40-Hour OSHA (HAZWOPER)

SELECTED PROJECTS

- 440 Washington Street, E-Designated services, New York, NY
- 3514 Surf Avenue, Tall Residential and Retail Building, Brooklyn, NY
- ARO 242 West 53, Tall Residential Building, New York, NY
- NY Aquarium Shark Exhibit, Soil Characterization and Excavation Oversight, Coney Island Neighborhood, Brooklyn, NY
- 60 West Street, Site Investigation and Redevelopment, Brooklyn, NY
- 535 4th Avenue, BCP Auto Repair Cleanup and Redevelopment, Brooklyn, NY
- 1525 Bedford Avenue, BCP Gas Station Cleanup and Redevelopment, Brooklyn, NY
- 220 Eleventh Avenue, Residential Building, New York, NY
- 432 Rodney Street, Residential Building, Brooklyn, NY
- 563 Sackett Street, Brooklyn, NY
- 362 West 125th Street, Residential Building, New York, NY
- Bedford Armory Redevelopment, Brooklyn, NY
- 268 West Street, BCP Redevelopment of Former Commercial and Industrial Site, New York, NY
- 110 125th Street, Soil Excavation and Remediation, New York, NY
- Former Roseland Ballroom Redevelopment, Soil Characterization and Excavation Oversight, New York, NY
- 42 Crosby Street, "E" Designated Site Investigation and Remediation, New York, NY
- New York School Construction Authority, Various Locations, In-House Environmental Consulting, Five Boroughs of New York City
- EZ Serve Portfolio, GE Capital, Various Phase II Site Investigations, FL, GA, LA, and MS
- Beth Elohim Child Daycare Center, Lead Based Paint Abatement, Brooklyn, NY
- Price Battery, Environmental Protection Agency (EPA) Lead Fallout Superfund Site, Hamburg, PA

- Clark Portfolio, GE Capital, Various Phase II Locations, MI, IL, ID, and OH
- Tops Plaza Portfolio, Prudential Real Estate Investors, Various Phase II Locations, NY
- Cingular Wireless Portfolio, Cingular Wireless, Various Locations Phase I and II Locations, WA
- Queens Center Mall Expansion, Remedial Oversight, Elmhurst, NY
- Soka Gakkai International-USA, Cultural Center, Brooklyn, NY
- 1752 Shore Parkway, Environmental Remediation, Brooklyn, NY
- Bedford Union Armory, NYS Brownfield Cleanup Program, Brooklyn, NY
- NYCEDC Manhattan Greenway – Harlem River, New York, NY
- 445 Gerard Avenue, Residential Building, Bronx, NY
- Towne Gardens North, Residential Building, Buffalo, NY

APPENDIX B

SITE PHOTOGRAPHS

LANGAN

Photograph Log

Client Name:	Site Location:	Project No.
McCormack Baron Salazar Development, Inc. (MBSDI)	East Adams Redevelopment Phase VI Area, Syracuse, NY	170859701

Date	Photo No.
10/15/2025	1

Direction Photo Taken:

East

Description:

View of Nothnagle Drilling Inc. (Nothnagle) advancing the Geoprobe 6712DT drill rig at soil vapor point P6SV03.

Date	Photo No.
10/15/2025	2

Direction Photo Taken:

West

Description:

View of utility mark-outs at soil boring P6SB04.

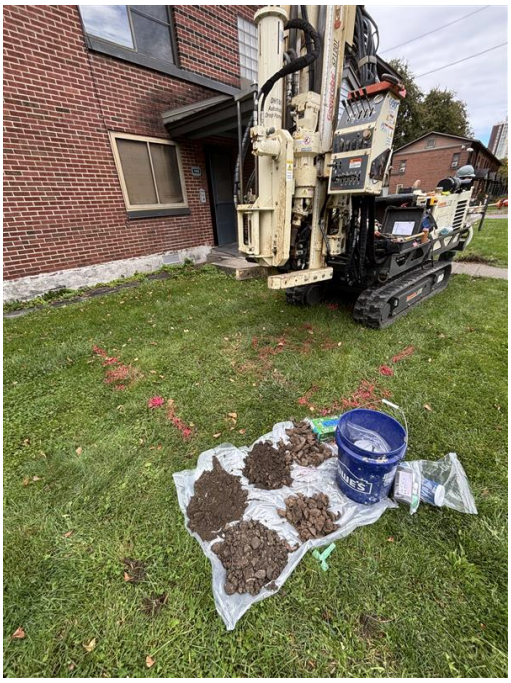

LANGAN

Photograph Log

Client Name:	Site Location:	Project No.
McCormack Baron Salazar Development, Inc. (MBSDI)	East Adams Redevelopment Phase VI Area, Syracuse, NY	170859701

Date	Photo No.
10/15/2025	3

Direction Photo Taken:

Down

Description:

View of recovered soil/fill from hand clear of soil boring P6SB06.

Date	Photo No.
10/16/2025	4

Direction Photo Taken:

West

Description:

View of Nothnagle installing soil vapor point P6SV02.

LANGAN

Photograph Log

Client Name:	Site Location:	Project No.
McCormack Baron Salazar Development, Inc. (MBSDI)	East Adams Redevelopment Phase VI Area, Syracuse, NY	170859701

Date	Photo No.
10/16/2025	5

Direction Photo Taken:

Down

Description:

View of soil vapor sampling at P6SV10.

Date	Photo No.
10/16/2025	6

Direction Photo Taken:

Down

Description:

View of recovered soil/fill from soil boring P6SB08.

LANGAN

Photograph Log

Client Name:	Site Location:	Project No.
McCormack Baron Salazar Development, Inc. (MBSDI)	East Adams Redevelopment Phase VI Area, Syracuse, NY	170859701

Date	Photo No.
10/16/2025	7

Direction Photo Taken:

East

Description:

View of soil vapor and ambient air sampling at P6SV02 and P6AA01, respectively.

Date	Photo No.
10/15/2025	8

Direction Photo Taken:

Down

Description:

View of recovered soil from soil boring P6SB10.

APPENDIX C

GEOPHYSICAL SURVEY

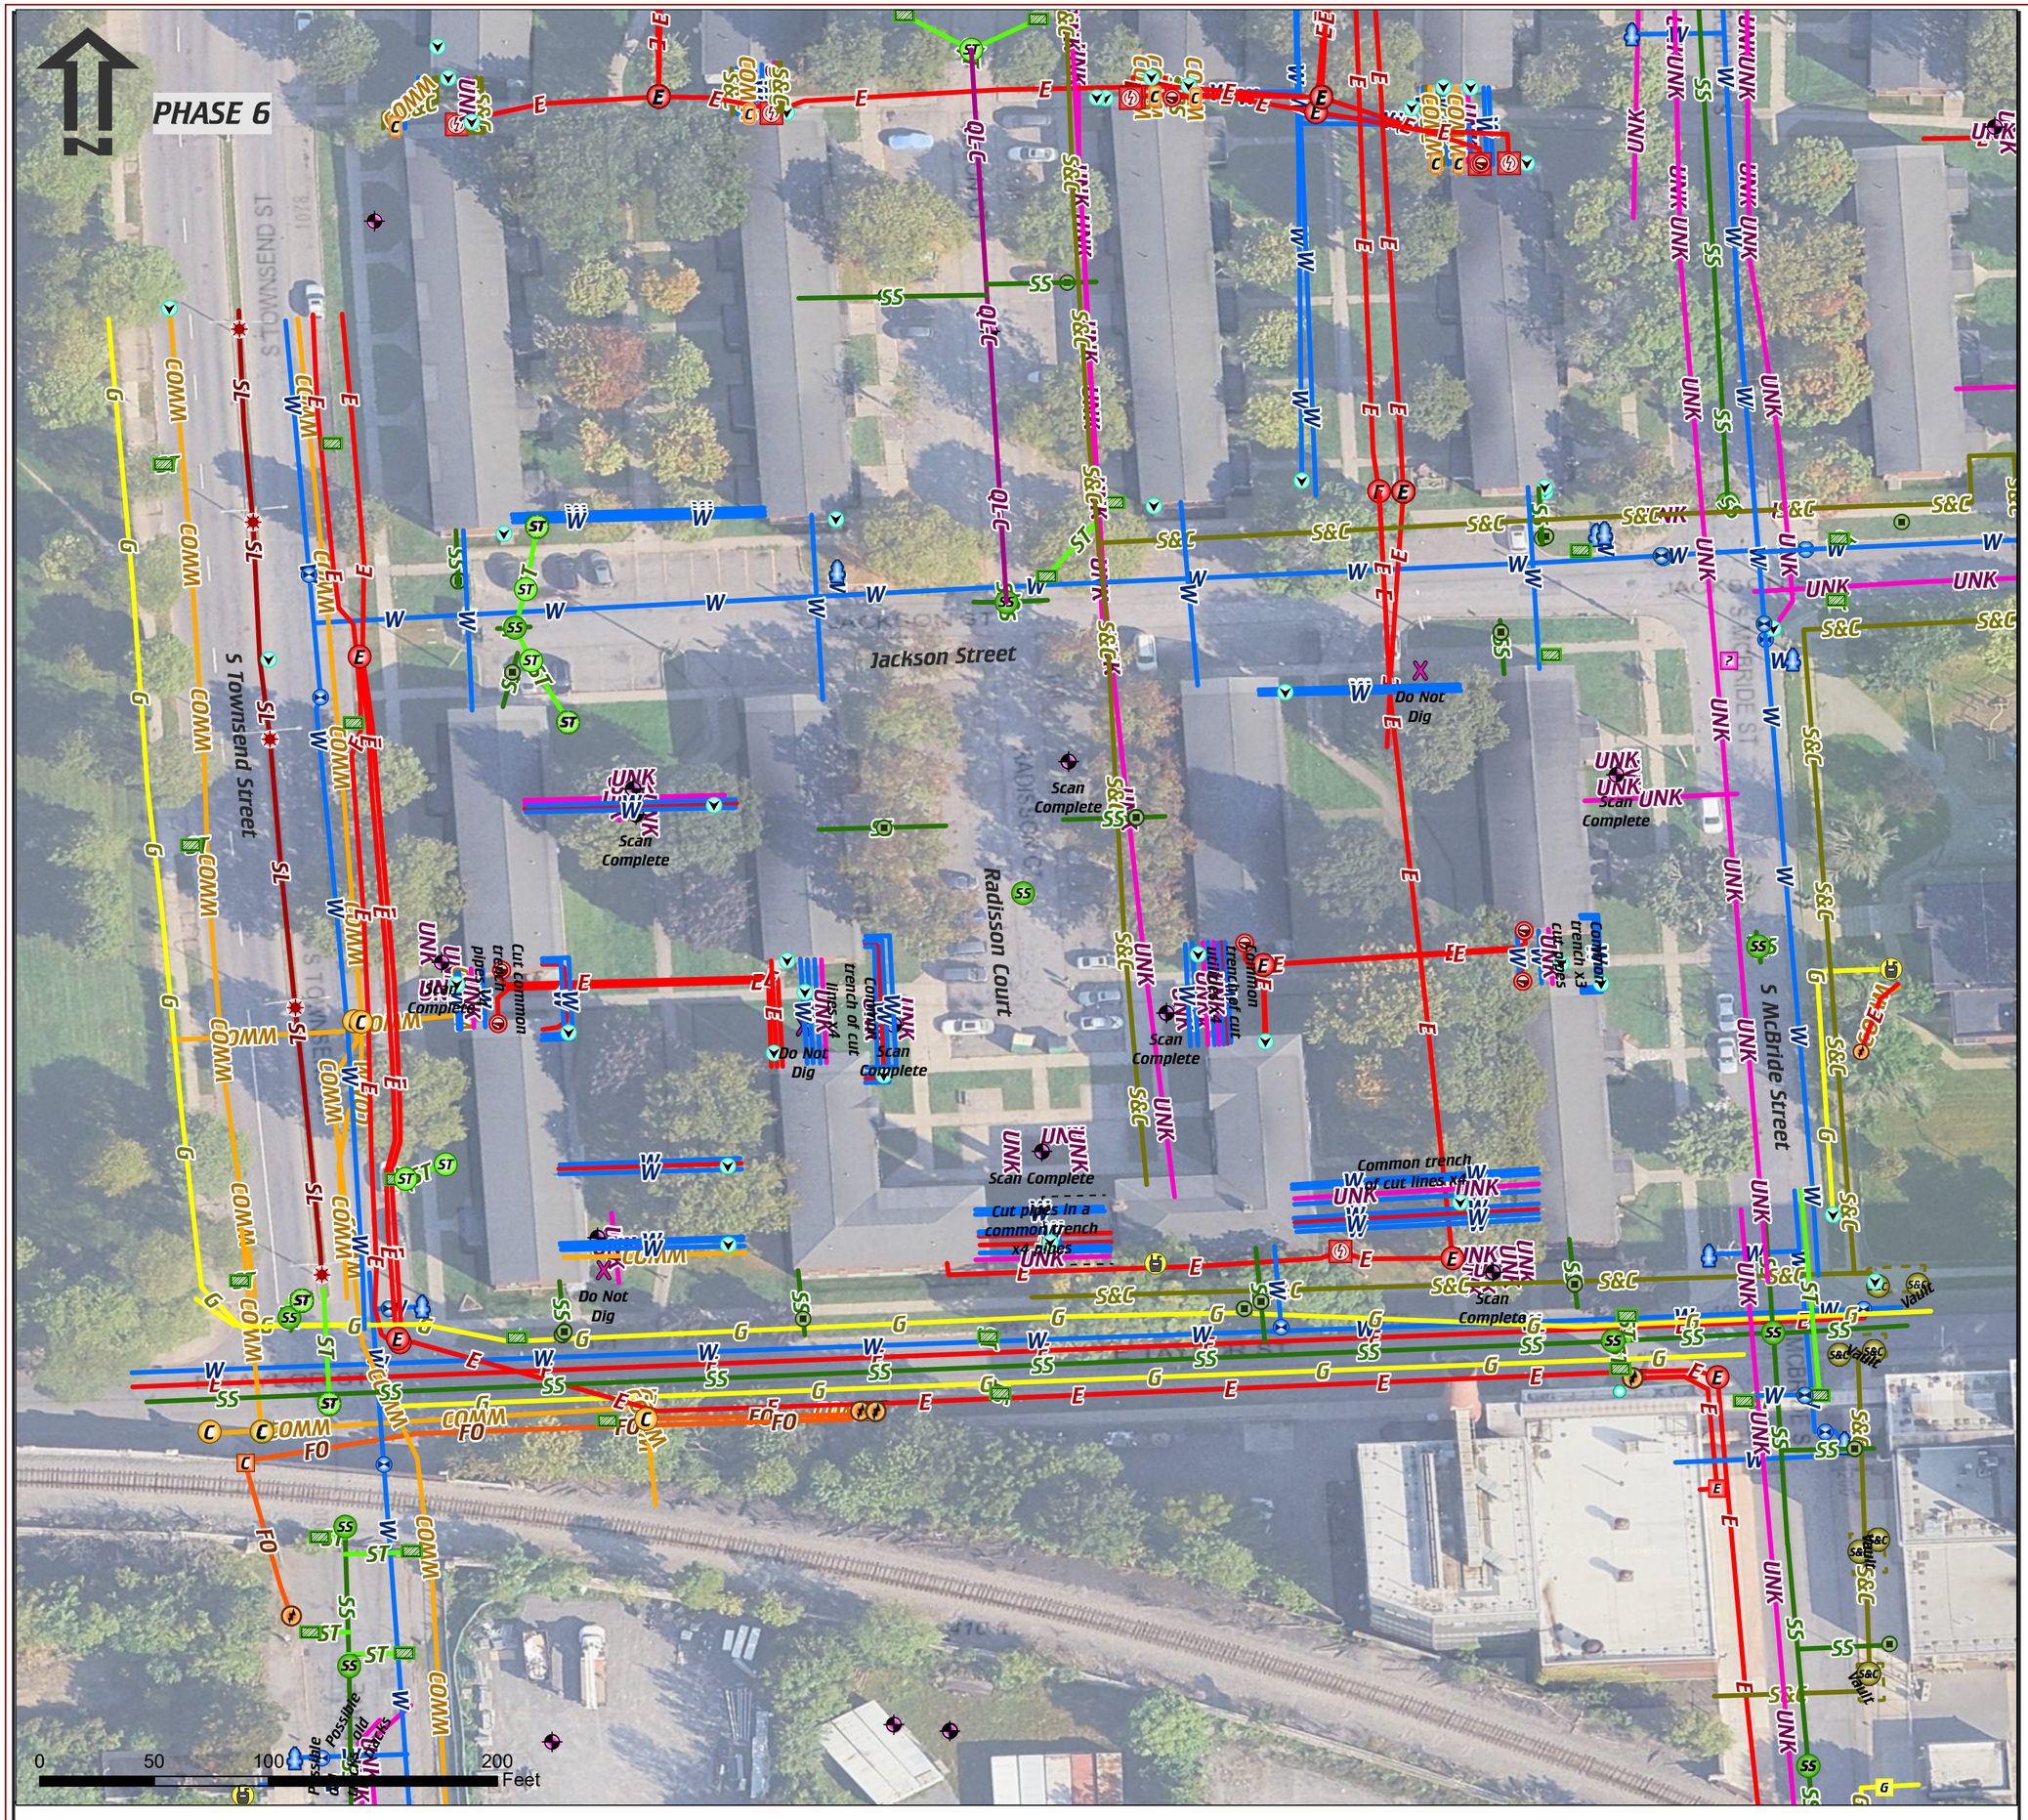

CLIENT: Langan Engineering **USI TECH:** T Johnson **DATE:** **USI PROJECT NUMBER:** 145830 **PREPARED BY:** RJS **PAGE:**

SoftDig

Underground Services, Inc.

DESIGN ACCURATELY, BUILD CONFIDENTLY

Utility Locating | Vacuum Excavation
Subsurface Utility Engineering | GPR Investigations
Video Pipe Inspection | Concrete Slab Imaging

SITE AND LOCATION

Syracuse Housing Authority

119 Radisson Ct, Syracuse, NY

COLOR CODE:

ELECTRIC:	Electric and Site Lighting Power Lines, Cables, Conduits and Duct Banks
COMM:	Telephone, Fiber Optic & Cable TV Lines, Cables, Conduits, and Duct Banks
GAS:	Natural Gas, Propane, Petroleum, Oil, Steam, Gaseous Chemical, and Flammable Gas Pipes and Casings
WATER:	Domestic, Potable, and Fire Protection Water Pipes and Casings
SEWER / STORM:	Sanitary Sewer and Force Main Pipes Storm Drain Pipes and Culverts
DOT SIGNAL:	DOT Traffic Signal, ITMS, and Control Lines, Cables, Conduits, and Trip Wires
UNKNOWN:	Unknown Anomalies, Lines, Cables, Conduits, Pipes, and Other Unidentified Facilities
RECLAIMED WATER:	Reclaimed Water, Irrigation, and Slurry Lines

LEGEND

- Elec_Meter
- Elec_Handbox
- Elec_Manhole
- Elec_Transformer
- Comm_Pedestal
- Comm_Handbox
- Comm_Manhole
- Gas_Meter
- Steam&Cond_Manhole
- Field Note
- Soil Boring_Others
- Soil Boring_USI
- Storm_Catch_Basin
- SanSwr_Manhole
- SanSwr_Cleanout
- Water_Valve
- Water_Fire_Hydrant
- Utility_Pole
- Basement Areaway Extension
- TRENCH Common Trench
- Unfinished Area
- Vault

CLARIFICATIONS

All information in this document is based on field sketches and observations by Underground Services, Inc. (USI) technicians. These sketches are conceptual, not to scale, and show only relative locations; they are not a land survey. USI employed standard geophysical methods to designate subsurface utilities, but unless this work is reviewed and sealed by a state-licensed Professional Engineer (PE) it is not a Subsurface Utility Engineering (SUE) investigation under ASCE/UESI/CI 38-22. Field markings reflect only utilities identified with the available methods and records, and USI does not warrant that every utility within the limits has been located. Before excavation, utilities at potential conflict points must be exposed by USI or its designee to reduce the risk of injury or damage. Depth readings are approximate, provided "as-is," and must not be used as the sole basis for design or construction; true depth can be confirmed only by exposure, and reliance on instrument depths is at the client's risk.

Quality Level B (QL-B) denotes utilities detected using geophysical methods and horizontally positioned with surface geophysics. All utilities shown are QL-B unless otherwise noted. Quality Level C (QL-C) aligns record data to observed above-ground features and may lack at grade marks. Quality Level D (QL-D) is derived solely from records or oral information, including unverified field paint. As a best practice, information shown as QL-C or QL-D should be confirmed by Quality Level A (test hole) methods before design or excavation proceeds. Use of ASCE/UESI/CI 38-22 quality-level terminology in this document does not signify that a comprehensive SUE report has been produced or that all standard requirements have been satisfied; a full SUE deliverable must be prepared, reviewed, and sealed by a state-licensed Professional Engineer.

PROVIDING UNDERGROUND UTILITY MAPPING SERVICES TO THE EASTERN UNITED STATES AND TEXAS

1-877-SoftDig
www.softdig.com / softdig@softdig.com

APPENDIX D

SOIL BORING LOGS

LANGAN

Log of Boring **P6SB01** Sheet 1 of 1

Project: East Adams Redevelopment - Phase VI Area	Project No.: 170859701
Location: Radisson Court, Syracuse, New York	Elevation and Datum: N/A
Drilling Company: Nothnagle Drilling, Inc.	Date Started: 10/16/2025 — Date Finished: 10/16/2025
Drilling Equipment: Geoprobe 6712DT	Completion Depth: 10.0 ft — Rock Depth: Not Encountered
Size and Type of Bit: 2.25 in OD / 2 in ID	Number of Samples: Disturbed 3 — Undisturbed 0 — Core 0
Casing Diameter (in): 2.00 — Casing Depth (ft): N/A	Water Level (ft.): First ▽ 8.5 — Completion ▼ N/A — 24 HR. ▼ N/A
Casing Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	Drilling Foreman: Jason Earsing
Sampler: Macrocore	Field Engineer: Jacob Geesin
Sampler Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	

Material Symbol	Elev. (ft)	Sample Description	Depth Scale	Sample Data: Number	Type	Recov. (in)	Penetr-resist BL/6in	PID Reading (ppm)	Remarks (Drilling Fluid, Casing Depth, Fluid Loss, Drilling Resistance, etc.)
	N/A	Grayish brown fine SAND, some silt, trace fine subangular gravel, fibrous vegetation (dry) [FILL]	0					0.0	Precleared to 2.5 feet depth by hand auger.
			1					0.0	P6SB01_0-1
			2					0.0	
								0.0	
	N/A	Brownish gray fine SILTY SAND, trace fine subangular gravel (dry) [FILL]	3	M-1	Macrocore	12/30		0.0	
								0.0	
		Brownish gray fine SILTY SAND, trace fine subangular gravel, brick (dry) [FILL]	4					0.0	
				M-2A					
			5						P6SB01_5-6
	N/A	Brown CLAY (moist) [CL]	6	M-2B	Macrocore	48/48		0.0	
			7					0.0	
								0.0	
		Dark brown CLAY (wet) [CL] ▽	8					0.0	
								0.0	
	N/A		9	M-3	Macrocore	17/24		0.0	
		End of Boring at 10.0ft.	10						Backfilled to grade with cuttings.
			11						
			12						

LANGAN

Log of Boring **P6SB02/TMW02** Sheet 1 of 1

Project: East Adams Redevelopment Phase VI	Project No.: 170859701
Location: Radisson Court, Syracuse, New York	Elevation and Datum: N/A
Drilling Company: Nothnagle Drilling, Inc.	Date Started: 10/16/2025 — Date Finished: 10/16/2025
Drilling Equipment: Geoprobe 6712DT	Completion Depth: 16.0 ft — Rock Depth: Not Encountered
Size and Type of Bit: 2.25 in OD / 2 in ID	Number of Samples: Disturbed 4 — Undisturbed 0 — Core 0
Casing Diameter (in): 2.00 — Casing Depth (ft): N/A	Water Level (ft.): First ▽ 6.5 — Completion ▼ N/A — 24 HR. ▼ N/A
Casing Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	Drilling Foreman: Jason Earsing
Sampler: Macrocore	Field Engineer: Alyssa Barr
Sampler Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	

Material Symbol	Elev. (ft)	Sample Description	Depth Scale	Sample Number	Sample Type	Recov. (in)	Penetr-resist BL/6in	PID Reading (ppm)	Remarks (Drilling Fluid, Casing Depth, Fluid Loss, Drilling Resistance, etc.)
	N/A	ASPHALT	0						Precleared to 5 feet depth by hand auger.
	N/A	Brown CLAY, trace fine sand (moist) [FILL]	1	M-1A				0.0	
			1	M-1B	Macrocore	38/48		0.0	P6SB02_1-2
			2						
		CLAY, trace fine sand (moist) [FILL]	2	M-1C					
		Brown CLAY, trace fine sand (moist) [FILL]	3	M-1D				0.0	P6SB02_3-4
	N/A	Brown CLAY, trace fine sand (moist) [CL]	4					0.0	
			5	M-2A				0.0	
			6		Macrocore	46/48		0.0	
		Brown CLAY, trace fine sand (wet) [CL] ▽	6					0.0	
			7	M-2B				0.0	
	N/A	Brown fine SAND, trace clay (wet) [SP-SC]	8					0.0	
			8					0.0	
			9	M-3A				0.0	
	N/A	Brown CLAY, trace fine sand (wet) [SP-SC]	10		Macrocore	48/48		0.0	
			10					0.0	
			11	M-3B				0.0	
	N/A	Brown fine SAND, trace clay (wet) [SP-SC]	12					0.0	
			12					0.0	
			13	M-4A				0.0	
	N/A	Brown CLAY, trace fine sand (wet) [CL]	14		Macrocore	48/48		0.0	
			14					0.0	
			15	M-4B				0.0	Set 1-inch temporary monitoring well P6TMW02 with 10 feet of 0.010-slot screen PVC from 5 to 15 feet bgs. Backfilled to grade with cuttings after groundwater sampling.
	N/A	End of Boring at 16.0ft.	16					0.0	

LANGAN

Log of Boring **P6SB03/TMW03** Sheet 1 of 1

Project: East Adams Redevelopment Phase VI	Project No.: 170859701
Location: Radisson Court, Syracuse, New York	Elevation and Datum: N/A
Drilling Company: Nothnagle Drilling, Inc.	Date Started: 10/15/2025 — Date Finished: 10/15/2025
Drilling Equipment: Geoprobe 6712DT	Completion Depth: 15.0 ft — Rock Depth: Not Encountered
Size and Type of Bit: 2.25 in OD / 2 in ID	Number of Samples: Disturbed 3 — Undisturbed 0 — Core 0
Casing Diameter (in): 2.00 — Casing Depth (ft): N/A	Water Level (ft.): First ▽ 8.5 — Completion ▼ 8.2 — 24 HR. ▽ N/A
Casing Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	Drilling Foreman: Jason Earsing
Sampler: Macrocore	Field Engineer: Alyssa Barr
Sampler Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	

Material Symbol	Elev. (ft)	Sample Description	Depth Scale	Sample Data: Number	Type	Recov. (in)	Penetr-resist BL/6in	PID Reading (ppm)	Remarks (Drilling Fluid, Casing Depth, Fluid Loss, Drilling Resistance, etc.)
	N/A	Brown fine SILTY SAND, trace fine subangular gravel (moist) [FILL]	0						Precleared to 5 feet depth by hand auger.
		Brown fine SILTY SAND, trace fine subangular gravel, coal (moist) [FILL]	1					0.0	
			2	PC-1	DIST	60/60		0.0	P6SB03_1-2
		Brown CLAY, trace fine sand, trace fine subangular gravel, coal (dry) [FILL]	3					0.0	
	N/A	Brown CLAY (moist) [CL]	4					0.0	P6SB03_4-5
			5					0.0	
			6	M-1	Macrocore	46/48		0.0	
			7					0.0	
	N/A	Brown CLAY (moist) [CL]	8					0.0	
	N/A	Brown CLAY, some fine sand (moist) [SC] ▼ ▽						0.0	
	N/A	Brown fine SAND, trace clay (wet) [SP-SC]	9					0.0	
		Gray to brown CLAY (wet) [CL]	10	M-2	Macrocore	48/48		0.0	
			11						
		Brown CLAY (moist) [CL]	12					0.0	
			13	M-3	Macrocore	8/36		0.0	
			14						
	N/A		15						Set 1-inch temporary monitoring well P6TMW03 with 10 feet of 0.010-slot screen PVC from 5 to 15 feet bgs. Backfilled to grade with cuttings after groundwater sampling.
		End of Boring at 15.0ft.	16						

LANGAN

Log of Boring **P6SB04** Sheet 1 of 1

Project: East Adams Redevelopment Phase VI	Project No.: 170859701
Location: Radisson Court, Syracuse, New York	Elevation and Datum: N/A
Drilling Company: Nothnagle Drilling, Inc.	Date Started: 10/15/2025 — Date Finished: 10/15/2025
Drilling Equipment: Geoprobe 6712DT	Completion Depth: 10.0 ft — Rock Depth: Not Encountered
Size and Type of Bit: 2.25 in OD / 2 in ID	Number of Samples: Disturbed 2 — Undisturbed 0 — Core 0
Casing Diameter (in): 2.00 — Casing Depth (ft): N/A	Water Level (ft.): First ▽ 8.0 — Completion ▼ N/A — 24 HR. ▼ N/A
Casing Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	Drilling Foreman: Jason Earsing
Sampler: Macrocore	Field Engineer: Alyssa Barr
Sampler Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	

Material Symbol	Elev. (ft)	Sample Description
	N/A	Brown fine SILTY SAND, trace fine subangular gravel (moist) [FILL]
		Brown fine SILTY SAND, trace fine subangular gravel, coal, glass (moist) [FILL]
	N/A	Brown CLAY (moist) [CL]
		Brown CLAY (moist) [CL]
		Brown CLAY (moist) [CL]
		Brown CLAY (wet) [CL]
	N/A	End of Boring at 10.0ft.

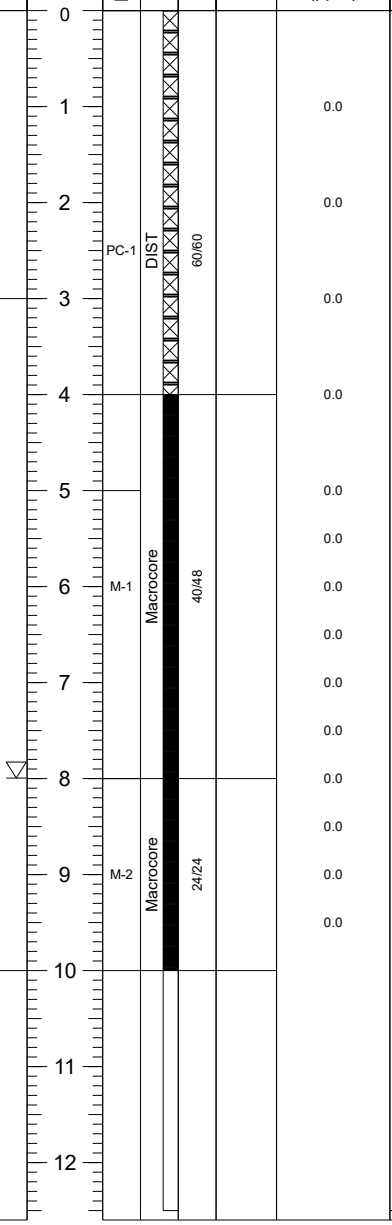

Sample Data					Remarks
Number	Type	Recov. (in)	Penetr-resist BL/6in	PID Reading (ppm)	(Drilling Fluid, Casing Depth, Fluid Loss, Drilling Resistance, etc.)
				0.0	Precleared to 5 feet depth by hand auger.
PC-1	DIST	60/60		0.0	P6SB04_0-1
				0.0	
				0.0	
				0.0	
M-1	Macrocore	40/48		0.0	P6SB04_4-5
				0.0	
				0.0	
				0.0	
				0.0	
				0.0	
M-2	Macrocore	24/24		0.0	
				0.0	
				0.0	
					Backfilled to grade with cuttings.

LANGAN

Log of Boring **P6SB05** Sheet 1 of 1

Project: East Adams Redevelopment - Phase VI Area	Project No.: 170859701
Location: Radisson Court, Syracuse, New York	Elevation and Datum: N/A
Drilling Company: Nothnagle Drilling, Inc.	Date Started: 10/16/2025 — Date Finished: 10/16/2025
Drilling Equipment: Geoprobe 6712DT	Completion Depth: 10.0 ft — Rock Depth: Not Encountered
Size and Type of Bit: 2.25 in OD / 2 in ID	Number of Samples: Disturbed 2 — Undisturbed 0 — Core 0
Casing Diameter (in): 2.00 — Casing Depth (ft): N/A	Water Level (ft.): First ▽ 8.2 — Completion ▼ N/A — 24 HR. ▼ N/A
Casing Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	Drilling Foreman: Jason Earsing
Sampler: Macrocore	Field Engineer: Jacob Geesin
Sampler Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	

Material Symbol	Elev. (ft)	Sample Description	Depth Scale	Sample Data: Number	Type	Recov. (in)	Penetr-resist BL/6in	PID Reading (ppm)	Remarks (Drilling Fluid, Casing Depth, Fluid Loss, Drilling Resistance, etc.)
	N/A	Brown fine SILTY SAND, trace fine subangular gravel (dry) [FILL]	0						Precleared to 5 feet depth by hand auger.
			1					0.0	P6SB05_1-2
			2					0.0	
			3					0.0	
	N/A	Brown CLAY (moist) [CL]	4					0.0	
			5					0.0	P6SB05_5-6
			6	M-1	Macrocore	12/48			
			7						
		Dark brown CLAY (moist) [CL] ▽	8					0.0	
			9	M-2	Macrocore	24/24		0.0	
	N/A	End of Boring at 10.0ft.	10					0.0	Backfilled to grade with cuttings.
			11						
			12						

LANGAN

Log of Boring **P6SB06** Sheet 1 of 1

Project: East Adams Redevelopment - Phase VI Area	Project No.: 170859701
Location: Radisson Court, Syracuse, New York	Elevation and Datum: N/A
Drilling Company: Nothnagle Drilling, Inc.	Date Started: 10/15/2025 — Date Finished: 10/15/2025
Drilling Equipment: Geoprobe 6712DT	Completion Depth: 10.0 ft — Rock Depth: Not Encountered
Size and Type of Bit: 2.25 in OD / 2 in ID	Number of Samples: Disturbed 2 — Undisturbed 0 — Core 0
Casing Diameter (in): 2.00 — Casing Depth (ft): N/A	Water Level (ft.): First ▽ 9.5 — Completion ▼ N/A — 24 HR. ▼ N/A
Casing Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	Drilling Foreman: Jason Earsing
Sampler: Macrocore	Field Engineer: Alyssa Barr
Sampler Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	

Material Symbol	Elev. (ft)	Sample Description
	N/A	Brown fine SILTY SAND, trace fine subangular gravel, metal (moist) [FILL]
		Gray to brown fine SILTY SAND, trace fine subangular gravel, metal, coal (dry) [FILL]
	N/A	Brown CLAY (moist) [CL]
		Brown CLAY (moist) [CL]
	N/A	Gray fine SAND, trace clay (moist) [SP-SC]
	N/A	Brown CLAY, trace fine sand (wet) [CL]
	N/A	End of Boring at 10.0ft.

Depth Scale	Number	Type	Recov. (in)	Penetr-resist BL/6in	PID Reading (ppm)	Remarks (Drilling Fluid, Casing Depth, Fluid Loss, Drilling Resistance, etc.)
0						Precleared to 5 feet depth by hand auger.
1	PC-1	DIST			0.0	P6SB06_0-1
2					0.0	
3					0.0	P6SB06_4-5
4	PC-2	DIST			0.0	
5					0.0	
6	M-1	Macrocore	39/48		0.0	
7					0.0	
8					0.0	
9	M-2A				0.0	
	M-2B	Macrocore	12/24		0.0	
10	M-2C					Backfilled to grade with cuttings.
11						
12						

LANGAN

Log of Boring **P6SB07** Sheet 1 of 1

Project: East Adams Redevelopment - Phase VI Area	Project No.: 170859701
Location: Radisson Court, Syracuse, New York	Elevation and Datum: N/A
Drilling Company: Nothnagle Drilling, Inc.	Date Started: 10/15/2025 — Date Finished: 10/15/2025
Drilling Equipment: Geoprobe 6712DT	Completion Depth: 10.0 ft — Rock Depth: Not Encountered
Size and Type of Bit: 2.25 in OD / 2 in ID	Number of Samples: Disturbed 2 — Undisturbed 0 — Core 0
Casing Diameter (in): 2.00 — Casing Depth (ft): N/A	Water Level (ft.): First ▽ 9.5 — Completion ▼ N/A — 24 HR. ▼ N/A
Casing Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	Drilling Foreman: Jason Earsing
Sampler: Macrocore	Field Engineer: Alyssa Barr
Sampler Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	

Material Symbol	Elev. (ft)	Sample Description
	N/A	Brown fine SILTY SAND, trace fine subangular gravel, construction debris (moist) [FILL]
	N/A	Brown CLAY, trace fine sand (moist) [CL]
		Brown CLAY (moist) [CL]
		Brown CLAY, trace fine sand (moist) [CL]
		Brown CLAY, trace fine sand (moist) [CL]
	N/A	Brown fine SAND, some clay (wet) [SC]
	N/A	End of Boring at 10.0ft.

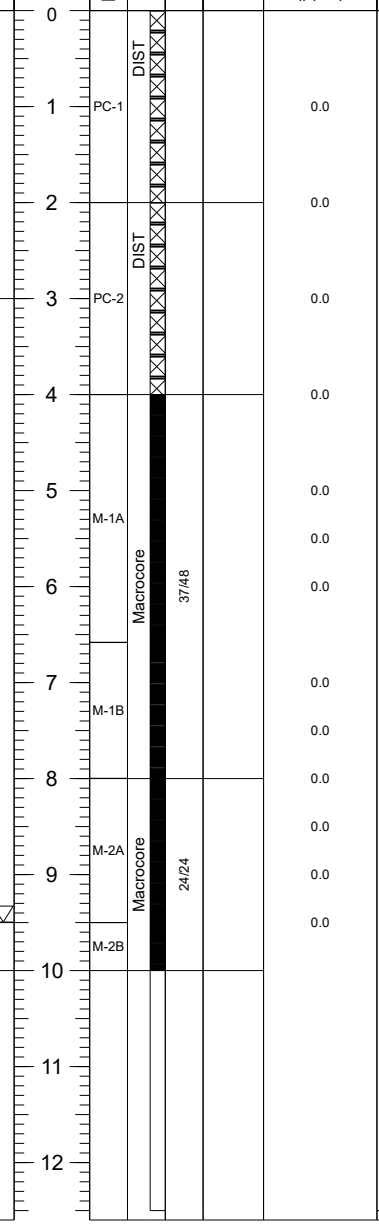

Number	Type	Recov. (in)	Penetr-resist BL/6in	PID Reading (ppm)	Remarks (Drilling Fluid, Casing Depth, Fluid Loss, Drilling Resistance, etc.)
					Precleared to 5 feet depth by hand auger.
PC-1	DIST			0.0	P6SB07_0-1
				0.0	P6SB07_2-3
PC-2	DIST			0.0	
				0.0	
M-1A	Macrocore	37/48		0.0	
				0.0	
				0.0	
M-1B				0.0	
				0.0	
				0.0	
M-2A	Macrocore	24/24		0.0	
				0.0	
M-2B					Backfilled to grade with cuttings.

LANGAN

Log of Boring **P6SB08** Sheet 1 of 1

Project: East Adams Redevelopment Phase VI	Project No.: 170859701
Location: Radisson Court, Syracuse, New York	Elevation and Datum: N/A
Drilling Company: Nothnagle Drilling, Inc.	Date Started: 10/16/2025 — Date Finished: 10/16/2025
Drilling Equipment: Geoprobe 6712DT	Completion Depth: 10.0 ft — Rock Depth: Not Encountered
Size and Type of Bit: 2.25 in OD / 2 in ID	Number of Samples: Disturbed 2 — Undisturbed 0 — Core 0
Casing Diameter (in): 2.00 — Casing Depth (ft): N/A	Water Level (ft.): First ▽ 7.3 — Completion ▼ N/A — 24 HR. ▼ N/A
Casing Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	Drilling Foreman: Jason Earsing
Sampler: Macrocore	Field Engineer: Alyssa Barr
Sampler Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	

Material Symbol	Elev. (ft)	Sample Description	Depth Scale	Sample Data: Number	Type	Recov. (in)	Penetr-resist BL/6in	PID Reading (ppm)	Remarks (Drilling Fluid, Casing Depth, Fluid Loss, Drilling Resistance, etc.)
	N/A	Brown fine SILTY SAND, trace fine subangular gravel (moist) [FILL]	0						Precleared to 5 feet depth by hand auger.
			1					0.0	P6SB08_0-1
		Gray to brown CLAY, some fine subangular gravel, trace fine sand (moist) [FILL]	2					0.0	
	N/A	Brown CLAY, trace fine sand (moist) [CL]	3	PC-1	DIST	60/60		0.0	P6SB08_2-3
		Brown CLAY, trace fine sand (moist) [CL]							
		Brown CLAY (moist) [CL]	4					0.0	
			5					0.0	
								0.0	
			6	M-1	Macrocore	24/48		0.0	
								0.0	
		Brown CLAY, trace fine sand (wet) [CL] ▽	7					0.0	
			8					0.0	
			9	M-2	Macrocore	10/24		0.0	
	N/A	End of Boring at 10.0ft.	10						Backfilled to grade with cuttings.
			11						
			12						

LANGAN

Log of Boring **P6SB09/TMW09** Sheet 1 of 1

Project: East Adams Redevelopment - Phase VI Area	Project No.: 170859701
Location: Radisson Court, Syracuse, New York	Elevation and Datum: N/A
Drilling Company: Nothnagle Drilling, Inc.	Date Started: 10/16/2025 — Date Finished: 10/16/2025
Drilling Equipment: Geoprobe 6712DT	Completion Depth: 16.0 ft — Rock Depth: Not Encountered
Size and Type of Bit: 2.25 in OD / 2 in ID	Number of Samples: Disturbed 3 — Undisturbed 0 — Core 0
Casing Diameter (in): 2.00 — Casing Depth (ft): N/A	Water Level (ft.): First ▽ 7.2 — Completion ▼ N/A — 24 HR. ▼ N/A
Casing Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	Drilling Foreman: Jason Earsing
Sampler: Macrocore	Field Engineer: Alyssa Barr
Sampler Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	

Material Symbol	Elev. (ft)	Sample Description	Depth Scale	Sample Data: Number	Type	Recov. (in)	Penetr-resist BL/6in	PID Reading (ppm)	Remarks (Drilling Fluid, Casing Depth, Fluid Loss, Drilling Resistance, etc.)
	N/A	Brown fine SILTY SAND, trace fine subangular gravel, coal, metal (moist) [FILL] SANDY SILT	0					0.0	Precleared to 5 feet depth by hand auger.
								0.0	
			1	PC-1	DIST			0.0	P6SB09_1-2
								0.0	
		Brown fine SILTY SAND, trace fine subangular gravel, coal, metal (moist) [FILL]	2					0.0	
								0.0	
			3					0.0	P6SB09_3-4
				PC-2	DIST			0.0	
	N/A		4					0.0	
		Brown CLAY (moist) [CL]						0.0	
			5	M-1A				0.0	
								0.0	
		Brown CLAY, trace fine sand (moist) [CL]	6	M-1B	Macrocore	35/48		0.0	
		Brown CLAY (moist) [CL]		M-1C					
			7 ▽						
		Brown CLAY (wet) [CL]		M-1D					
		Brown CLAY, trace fine sand (wet) [CL]	8					0.0	
								0.0	
			9					0.0	
								0.0	
			10	M-2	Macrocore	48/48		0.0	
								0.0	
			11					0.0	
								0.0	
		Brown CLAY, trace fine sand (wet) [CL]	12					0.0	
								0.0	
			13	M-3A				0.0	
								0.0	
		Brown CLAY, trace fine sand (wet) [CL]	14		Macrocore	48/48		0.0	Set 1-inch temporary monitoring well P6TMW04 with 10 feet of 0.010-slot screen PVC from 4 to 14 feet bgs. Backfilled to grade with cuttings after groundwater sampling.
				M-3B					
			15					0.0	
	N/A								
		End of Boring at 16.0ft.	16					0.0	
			17						
			18						

LANGAN

Log of Boring **P6SB10/TMW10** Sheet 1 of 1

Project: East Adams Redevelopment - Phase VI Area	Project No.: 170859701
Location: Radisson Court, Syracuse, New York	Elevation and Datum: N/A
Drilling Company: Nothnagle Drilling, Inc.	Date Started: 10/15/2025 — Date Finished: 10/15/2025
Drilling Equipment: Geoprobe 6712DT	Completion Depth: 15.0 ft — Rock Depth: Not Encountered
Size and Type of Bit: 2.25 in OD / 2 in ID	Number of Samples: Disturbed 3 — Undisturbed 0 — Core 0
Casing Diameter (in): 2.00 — Casing Depth (ft): N/A	Water Level (ft.): First ▽ 7.5 — Completion ▼ 8.6 — 24 HR. ▼ N/A
Casing Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	Drilling Foreman: Jason Earsing
Sampler: Macrocore	Field Engineer: Alyssa Barr
Sampler Hammer: N/A — Weight (lbs): N/A — Drop (in): N/A	

Material Symbol	Elev. (ft)	Sample Description	Depth Scale	Sample Data: Number	Type	Recov. (in)	Penetr-resist BL/6in	PID Reading (ppm)	Remarks (Drilling Fluid, Casing Depth, Fluid Loss, Drilling Resistance, etc.)
	N/A	Brown fine SILTY SAND, trace fine subangular gravel, glass (dry) [FILL]	0						Precleared to 5 feet depth by hand auger.
		Brown fine SILTY SAND, some fine subangular gravel (moist) [FILL]	1	PC-1	DIST			0.0	P6SB10_0-1
	N/A	Brown CLAY (dry) [CL]	2					0.0	P6SB10_2-3
			3	PC-2	DIST			0.0	
	N/A	Brown CLAY (moist) [CL]	4					0.0	
			5	M-1A	Macrocore	34/48		0.0	
			6					0.0	
		Brown CLAY (moist) [CL]	7	M-1B				0.0	
		Brown CLAY, trace fine sand, (wet) [CL] ▽		M-1C				0.0	
		Brown CLAY, trace fine sand (moist) [CL]	8	M-2A				0.0	
		Brown CLAY, trace fine sand (moist) [CL] ▼	9	M-2B				0.0	
		Brown CLAY, trace fine sand (wet) [CL]	10		Macrocore	48/48		0.0	
			11	M-2C				0.0	
	N/A		12					0.0	
		Brown fine SAND, trace silt (wet) [SP-SM]	13	M-3A	Macrocore	32/36		0.0	
			14					0.0	
	N/A		15						Set 1-inch temporary monitoring well P6TMW10 with 10 feet of 0.010-slot screen PVC from 5 to 15 feet bgs. Backfilled to grade with cuttings after groundwater sampling.
		End of Boring at 15.0ft.	16						
			17						
			18						

APPENDIX E

MONITORING WELL CONSTRUCTION AND GROUNDWATER SAMPLING LOGS

WELL CONSTRUCTION AND DEVELOPMENT SUMMARY

Well No. P6TMW02

PROJECT			PROJECT NO.	
East Adams Redevelopment - Phase VI			170859701	
LOCATION			**ELEVATION AND DATUM**	
Syracuse, NY			el. N/A	
DRILLING AGENCY			**DATE STARTED**	**DATE FINISHED**
Nothnagle Drilling Inc.			10/16/2026	10/16/2025
DRILLING EQUIPMENT			**DRILLER**	
Geoprobe® 6712 DT			Jason Earsing	
SIZE AND TYPE OF BIT			**INSPECTOR**	
2-inch Direct Push			Alyssa Barr	
BOREHOLE DIAMETER			**TYPE OF WELL (OVERBURDEN / BEDROCK)**	
2 inches			Overburden	
RISER MATERIAL	**DIAMETER**		**TYPE OF BACKFILL MATERIAL**	
PVC	1 inch		Cuttings	
TYPE OF SCREEN	**DIAMETER**		**TYPE OF WELL PACK**	**TYPE OF SEAL MATERIAL**
PVC No. 10 Slot	1 inch		No. 2 Sand	Bentonite

METHOD OF INSTALLATION

A Geoprobe® 6712DT drill rig was used to advance the boring to about 15 feet below grade surface (bgs). A one-inch (1") PVC monitoring well was installed which consisted of 10' of 10 slot (0.010-inch) slotted well screen and a solid 1" PVC riser. Well screen was installed from approximately 15 to 5 feet bgs with riser from 5 feet bgs to 2 feet above grade surface (ags). No. 2 clean sand was used to fill the annulus around the screen to 5 feet bgs.

WELL DEVELOPMENT DATA

SURGE BLOCK DIAMETER	N/A	**TYPE PUMP**	N/A	**DEVELOPMENT CONFIRMATION**
DRILLER OR LANGAN	N/A	**MAX PUMP RATE**	N/A	
NUMBER OF SURGE CYCLES	N/A	**TOTAL VOLUME**	N/A	N/A

TOP OF CASING	**ELEVATION** N/A	**DEPTH (ft)** -1.29
TOP OF SEAL	**ELEVATION** N/A	**DEPTH (ft)** N/A
TOP OF FILTER	**ELEVATION** N/A	**DEPTH (ft)** N/A
TOP OF SCREEN	**ELEVATION** N/A	**DEPTH (ft)** 5.0
BOTTOM OF BORING	**ELEVATION** N/A	**DEPTH (ft)** 15
SCREEN LENGTH		10 feet
SLOT SIZE		No. 10 Slot; 0.010 Inches

GROUNDWATER ELEVATIONS

ELEVATION	DATE	DEPTH TO WATER	
	10/16/2025	7.58	feet
ELEVATION	**DATE**	**DEPTH TO WATER**	
ELEVATION	**DATE**	**DEPTH TO WATER**	
ELEVATION	**DATE**	**DEPTH TO WATER**	
ELEVATION	**DATE**	**DEPTH TO WATER**	
ELEVATION	**DATE**	**DEPTH TO WATER**	

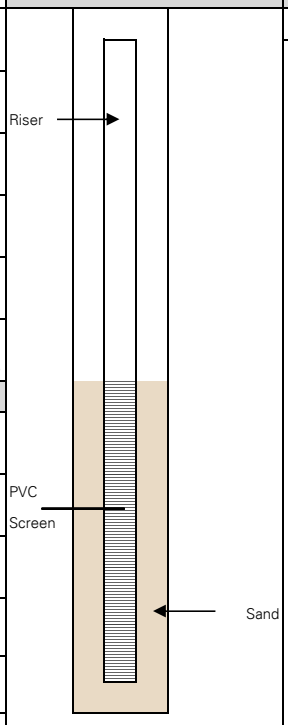

CLASSIFICATION	DEPTH (FT)
	-1.29
	5
	15

LANGAN Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C.

368 Ninth Avenue, 8th Floor, New York

WELL CONSTRUCTION AND DEVELOPMENT SUMMARY

Well No. P6TMW03

PROJECT		PROJECT NO.	
East Adams Redevelopment - Phase VI		170859701	
LOCATION		**ELEVATION AND DATUM**	
Syracuse, NY		el. N/A N/A	
DRILLING AGENCY		**DATE STARTED**	**DATE FINISHED**
Nothnagle Drilling Inc.		10/15/2025	10/15/2025
DRILLING EQUIPMENT		**DRILLER**	
Geoprobe® 6712 DT		Jason Earsing	
SIZE AND TYPE OF BIT		**INSPECTOR**	
2-inch Direct Push		Alyssa Barr	
BOREHOLE DIAMETER		**TYPE OF WELL (OVERBURDEN / BEDROCK)**	
2 inches		Overburden	
RISER MATERIAL	**DIAMETER**	**TYPE OF BACKFILL MATERIAL**	
PVC	1 inch	Cuttings	
TYPE OF SCREEN	**DIAMETER**	**TYPE OF WELL PACK**	**TYPE OF SEAL MATERIAL**
PVC No. 10 Slot	1 inch	No. 2 Sand	Bentonite

METHOD OF INSTALLATION

A Geoprobe® 6712DT drill rig was used to advance the boring to about 15 feet below grade surface (bgs). A one-inch (1") PVC monitoring well was installed which consisted of 10' of 10 slot (0.010-inch) slotted well screen and a solid 1" PVC riser. Well screen was installed from approximately 15 to 5 feet bgs with riser from 5 feet bgs to 2 feet above grade surface (ags). No. 2 clean sand was used to fill the annulus around the screen to 5 feet bgs.

WELL DEVELOPMENT DATA

SURGE BLOCK DIAMETER	N/A	**TYPE PUMP**	N/A	**DEVELOPMENT CONFIRMATION**
DRILLER OR LANGAN	N/A	**MAX PUMP RATE**	N/A	
NUMBER OF SURGE CYCLES	N/A	**TOTAL VOLUME**	N/A	N/A

TOP OF CASING **ELEVATION** N/A	**DEPTH (ft)** -1.23	
TOP OF SEAL **ELEVATION** N/A	**DEPTH (ft)** N/A	
TOP OF FILTER **ELEVATION** N/A	**DEPTH (ft)** N/A	
TOP OF SCREEN **ELEVATION** N/A	**DEPTH (ft)** 5.0	
BOTTOM OF BORING **ELEVATION** N/A	**DEPTH (ft)** 15	
SCREEN LENGTH	10 feet	
SLOT SIZE	No. 10 Slot; 0.010 Inches	

GROUNDWATER ELEVATIONS

ELEVATION	DATE	DEPTH TO WATER	
	10/15/2025	8.13	feet
ELEVATION	DATE	DEPTH TO WATER	
ELEVATION	DATE	DEPTH TO WATER	
ELEVATION	DATE	DEPTH TO WATER	
ELEVATION	DATE	DEPTH TO WATER	
ELEVATION	DATE	DEPTH TO WATER	

WELL DETAILS

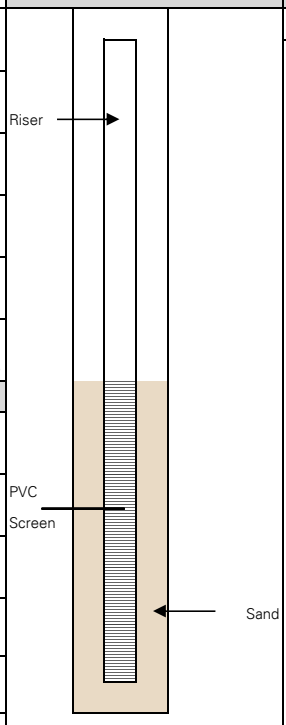

CLASSIFICATION	DEPTH (FT)
	-1.23
	5
	15

LANGAN Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C.

368 Ninth Avenue, 8th Floor, New York

WELL CONSTRUCTION AND DEVELOPMENT SUMMARY

Well No. P6TMW09

PROJECT		PROJECT NO.	
East Adams Redevelopment - Phase VI		170859701	
LOCATION		**ELEVATION AND DATUM**	
Syracuse, NY		el. N/A N/A	
DRILLING AGENCY		**DATE STARTED**	**DATE FINISHED**
Nothnagle Drilling Inc.		10/15/2025	10/15/2025
DRILLING EQUIPMENT		**DRILLER**	
Geoprobe® 6712 DT		Jason Earsing	
SIZE AND TYPE OF BIT		**INSPECTOR**	
2-inch Direct Push		Alyssa Barr	
BOREHOLE DIAMETER		**TYPE OF WELL (OVERBURDEN / BEDROCK)**	
2 inches		Overburden	
RISER MATERIAL	**DIAMETER**	**TYPE OF BACKFILL MATERIAL**	
PVC	1 inch	Cuttings	
TYPE OF SCREEN	**DIAMETER**	**TYPE OF WELL PACK**	**TYPE OF SEAL MATERIAL**
PVC No. 10 Slot	1 inch	No. 2 Sand	Bentonite

METHOD OF INSTALLATION

A Geoprobe® 6712DT drill rig was used to advance the boring to about 15 feet below grade surface (bgs). A one-inch (1") PVC monitoring well was installed which consisted of 10' of 10 slot (0.010-inch) slotted well screen and a solid 1" PVC riser. Well screen was installed from approximately 14 to 4 feet bgs with riser from 5 feet bgs to 2 feet above grade surface (ags). No. 2 clean sand was used to fill the annulus around the screen to 5 feet bgs.

WELL DEVELOPMENT DATA

SURGE BLOCK DIAMETER	N/A	**TYPE PUMP**	N/A	**DEVELOPMENT CONFIRMATION**
DRILLER OR LANGAN	N/A	**MAX PUMP RATE**	N/A	
NUMBER OF SURGE CYCLES	N/A	**TOTAL VOLUME**	N/A	N/A

TOP OF CASING **ELEVATION** N/A	**DEPTH (ft)** -1.44	
TOP OF SEAL **ELEVATION** N/A	**DEPTH (ft)** N/A	
TOP OF FILTER **ELEVATION** N/A	**DEPTH (ft)** N/A	
TOP OF SCREEN **ELEVATION** N/A	**DEPTH (ft)** 4.0	
BOTTOM OF BORING **ELEVATION** N/A	**DEPTH (ft)** 14	
SCREEN LENGTH	10 feet	
SLOT SIZE	No. 10 Slot; 0.010 Inches	

GROUNDWATER ELEVATIONS

ELEVATION	DATE	DEPTH TO WATER	
	10/15/2025	9.3	feet
ELEVATION	**DATE**	**DEPTH TO WATER**	
ELEVATION	**DATE**	**DEPTH TO WATER**	
ELEVATION	**DATE**	**DEPTH TO WATER**	
ELEVATION	**DATE**	**DEPTH TO WATER**	
ELEVATION	**DATE**	**DEPTH TO WATER**	

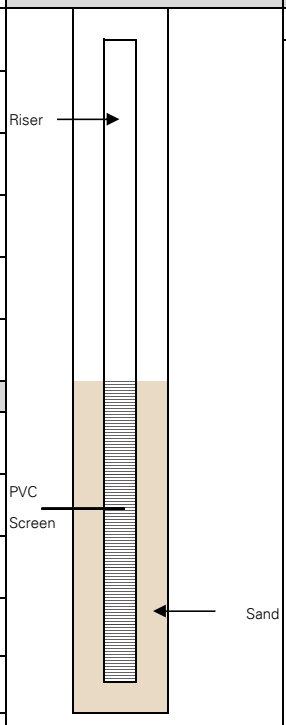

CLASSIFICATION	DEPTH (FT)
	-1
	4
	14

LANGAN Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C.

368 Ninth Avenue, 8th Floor, New York

WELL CONSTRUCTION AND DEVELOPMENT SUMMARY

Well No. P6TMW10

PROJECT		PROJECT NO.	
East Adams Redevelopment - Phase VI		170859701	
LOCATION		**ELEVATION AND DATUM**	
Syracuse, NY		el. N/A N/A	
DRILLING AGENCY		**DATE STARTED**	**DATE FINISHED**
Nothnagle Drilling Inc.		10/15/2025	10/15/2025
DRILLING EQUIPMENT		**DRILLER**	
Geoprobe® 6712 DT		Jason Earsing	
SIZE AND TYPE OF BIT		**INSPECTOR**	
2-inch Direct Push		Alyssa Barr	
BOREHOLE DIAMETER		**TYPE OF WELL (OVERBURDEN / BEDROCK)**	
2 inches		Overburden	
RISER MATERIAL	**DIAMETER**	**TYPE OF BACKFILL MATERIAL**	
PVC	1 inch	Cuttings	
TYPE OF SCREEN	**DIAMETER**	**TYPE OF WELL PACK**	**TYPE OF SEAL MATERIAL**
PVC No. 10 Slot	1 inch	No. 2 Sand	Bentonite

METHOD OF INSTALLATION

A Geoprobe® 6712DT drill rig was used to advance the boring to about 15 feet below grade surface (bgs). A one-inch (1") PVC monitoring well was installed which consisted of 10' of 10 slot (0.010-inch) slotted well screen and a solid 1" PVC riser. Well screen was installed from approximately 15 to 5 feet bgs with riser from 5 feet bgs to 2 feet above grade surface (ags). No. 2 clean sand was used to fill the annulus around the screen to 5 feet bgs.

WELL DEVELOPMENT DATA

SURGE BLOCK DIAMETER	N/A	**TYPE PUMP**	N/A	**DEVELOPMENT CONFIRMATION**
DRILLER OR LANGAN	N/A	**MAX PUMP RATE**	N/A	
NUMBER OF SURGE CYCLES	N/A	**TOTAL VOLUME**	N/A	N/A

TOP OF CASING **ELEVATION** N/A	**DEPTH (ft)** -1.38	
TOP OF SEAL **ELEVATION** N/A	**DEPTH (ft)** N/A	
TOP OF FILTER **ELEVATION** N/A	**DEPTH (ft)** N/A	
TOP OF SCREEN **ELEVATION** N/A	**DEPTH (ft)** 5.0	
BOTTOM OF BORING **ELEVATION** N/A	**DEPTH (ft)** 15	
SCREEN LENGTH	10 feet	
SLOT SIZE	No. 10 Slot; 0.010 Inches	

GROUNDWATER ELEVATIONS

ELEVATION	DATE	DEPTH TO WATER	
	10/15/2025	9.95	feet
ELEVATION	**DATE**	**DEPTH TO WATER**	
ELEVATION	**DATE**	**DEPTH TO WATER**	
ELEVATION	**DATE**	**DEPTH TO WATER**	
ELEVATION	**DATE**	**DEPTH TO WATER**	
ELEVATION	**DATE**	**DEPTH TO WATER**	

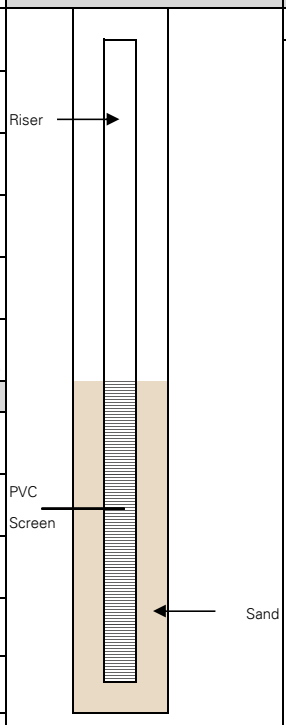

CLASSIFICATION	DEPTH (FT)
	-1
	5
	15

LANGAN Engineering, Environmental, Surveying, Landscape Architecture and Geology, D.P.C.

368 Ninth Avenue, 8th Floor, New York

APPENDIX F

SOIL VAPOR POINT CONSTRUCTION AND SAMPLING LOGS

SOIL VAPOR POINT INSTALLATION/SAMPLING LOG SHEET

Location ID: P6SV02 Sample ID: P6SV02_101625

PROJECT: East Adams Redevelopment - Phase VI	**PROJECT NO.:** 170859701	
LOCATION: Syracuse, NY	**SURFACE ELEVATION AND DATUM:** N/A	
DRILLING FIRM OR LANGAN INSTALLER: Nothnagle Drilling Inc.	**INSTALLATION DATE STARTED:** 10/16/2025	**DATE FINISHED:** 10/16/2025
INSTALLATION FOREMAN: Jason Earsing	**SAMPLE DATE STARTED:** 10/16/2025	**DATE FINISHED:** 10/16/2025
INSTALLATION EQUIPMENT: Geoprobe	**TYPE OF SAMPLING DEVICE:** 6-Liter Summa Canister	
INSPECTOR: Alyssa Barr	**SAMPLER:** Alyssa Barr	
POTENTIAL SAMPLE INTERFERENCES: P6SV02 collected within active parking lot in apartment complex. Minimal vehicles observed coming and going during sampling period.	**WEATHER CONDITIONS (PRECIP., TEMP., PRESS., WIND SPEED AND DIR.):** Temp: 36 - 54 F Wind: 9 - 17 mph NW Precipitation: 0% Pressure: 29.7	

METHOD OF INSTALLATION AND PURGING:

Nothnagle advanced a GeoProbe 6712DT to about 4 feet below grade surface (bgs) and installed the vapor point. The borehole was backfilled to about 3 feet bgs with No. 2 sand. The remainder of the borehole was sealed with hydrated bentonite. The flow controller was zeroed and valve opened to initiate the 2-hour sample. The sample and flow controller were checked every 30 minutes during sampling to ensure proper operation.

TUBING TYPE/DIAMETER: 3/8-inch OD by 1/4-inch ID polyethylene tubing	**TYPE OF MATERIAL ABOVE SEAL:** N/A
IMPLANT SCREEN TYPE/LENGTH/DIAMETER: 6-Inch Stainless Steel Probe	**SEAL MATERIAL (Bentonite, Beeswax, Modeling Clay, etc.):** Bentonite
BOREHOLE DIAMETER: 2 inches	**FILTER PACK MATERIAL (Sand or Glass Beads):** No. 2 Sand

PURGE VOLUME (L):	0.2
PURGE FLOW RATE (ML/MIN):	0.2
PID AFTER PURGE (PPM):	0.0

HELIUM TESTS	Pre-sampling	Post-sampling
HELIUM TEST IN BUCKET(%):	17.3%	14.7%
HELIUM TEST IN TUBE (PPM):	0.0	0.0

SAMPLE START TIME:	14:00
SAMPLE STOP TIME:	16:02
TOTAL SAMPLE TIME (MIN):	122
REGULATOR FLOW RATE (L/MIN):	0.04
VOLUME OF SAMPLE (LITERS):	6
PID AFTER SAMPLE (PPM):	0.0
SAMPLE MOISTURE CONTENT:	N/A
CAN SERIAL NUMBER:	2316
REGULATOR SERIAL NUMBER:	03095
CAN START VACUUM PRESS. (" HG):	-29.87
CAN STOP VACUUM PRESS. (" HG):	-5.22

IMPLANT/PROBE DETAILS (SEAL, FILTER, ETC.)



DEPTH (FEET FROM SURFACE)	**NOTES**
0	
3	
4	

SAMPLE LOCATION SKETCH

See Sample Location Plan

NOTES

N/A

Langan Engineering, Environmental, Surveying, Landscape Architecture, and Geology D.P.C.
368 Ninth Avenue, 8th Floor, New York, NY 10001

SOIL VAPOR POINT INSTALLATION/SAMPLING LOG SHEET

Location ID: P6SV03 Sample ID: P6SV03_101625

PROJECT: East Adams Redevelopment - Phase VI	**PROJECT NO.:** 170859701	
LOCATION: Syracuse, NY	**SURFACE ELEVATION AND DATUM:** N/A	
DRILLING FIRM OR LANGAN INSTALLER: Nothnagle Drilling Inc.	**INSTALLATION DATE STARTED:** 10/15/2025	**DATE FINISHED:** 10/15/2025
INSTALLATION FOREMAN: Jason Earsing	**SAMPLE DATE STARTED:** 10/16/2025	**DATE FINISHED:** 10/16/2025
INSTALLATION EQUIPMENT: Geoprobe	**TYPE OF SAMPLING DEVICE:** 6-Liter Summa Canister	
INSPECTOR: Alyssa Barr	**SAMPLER:** Alyssa Barr	
POTENTIAL SAMPLE INTERFERENCES: None	**WEATHER CONDITIONS (PRECIP., TEMP., PRESS., WIND SPEED AND DIR.):** Temp: 36 - 54 F Wind: 9 - 17 mph NW Precipitation: 0% Pressure: 29.7	

METHOD OF INSTALLATION AND PURGING:

Example Text: Nothnagle advanced soil vapor point to 5 feet below the ground surface. The borehole was backfilled with No. 2 sand to about 4 feet bgs. The remainder of the borehole was sealed with hydrated bentonite. Prior to sample collection, a one-minute purge was conducted to purge the probe of approximately three tubing volumes. Sample consisted of 6 L Summa canister fitted with an 2-hour flow control valve. The flow controller was zeroed and valve opened to initiate the 2-hour sample collection. The sample and flow controller were checked every 30 minutes during sampling to ensure proper operation.

TUBING TYPE/DIAMETER: 3/8-inch OD by 1/4-inch ID polyethylene tubing	**TYPE OF MATERIAL ABOVE SEAL:** N/A
IMPLANT SCREEN TYPE/LENGTH/DIAMETER: 6-Inch Stainless Steel Probe	**SEAL MATERIAL (Bentonite, Beeswax, Modeling Clay, etc.):** Bentonite
BOREHOLE DIAMETER: 2 inches	**FILTER PACK MATERIAL (Sand or Glass Beads):** No. 2 Sand

PURGE VOLUME (L):	0.2	
PURGE FLOW RATE (ML/MIN):	0.2	
PID AFTER PURGE (PPM):	0.0	
HELIUM TESTS	Pre-sampling	Post-sampling
HELIUM TEST IN BUCKET(%):	19.1%	16.4%
HELIUM TEST IN TUBE (PPM):	0.0	0.0
SAMPLE START TIME:	13:46	
SAMPLE STOP TIME:	15:47	
TOTAL SAMPLE TIME (MIN):	121	
REGULATOR FLOW RATE (L/MIN):	0.04	
VOLUME OF SAMPLE (LITERS):	6	
PID AFTER SAMPLE (PPM):	0.0	
SAMPLE MOISTURE CONTENT:	N/A	
CAN SERIAL NUMBER:	4276	
REGULATOR SERIAL NUMBER:	03094	
CAN START VACUUM PRESS. (" HG):	-29.30	
CAN STOP VACUUM PRESS. (" HG):	-5.80	

IMPLANT/PROBE DETAILS (SEAL, FILTER, ETC.)		**DEPTH (FEET FROM SURFACE)**	**NOTES**
SURFACE / SURFACE	**Top of Seal**	0	
	Top of Pack	3.5	
	Tube Depth	5	

SAMPLE LOCATION SKETCH

See Sample Location Plan

NOTES

N/A

Langan Engineering, Environmental, Surveying, Landscape Architecture, and Geology D.P.C.
368 Ninth Avenue, 8th Floor, New York, NY 10001

SOIL VAPOR POINT INSTALLATION/SAMPLING LOG SHEET

Location ID: P6SV09 Sample ID: P6SV09_101625

PROJECT: East Adams Redevelopment - Phase VI	**PROJECT NO.:** 170859701	
LOCATION: Syracuse, NY	**SURFACE ELEVATION AND DATUM:** N/A	
DRILLING FIRM OR LANGAN INSTALLER: Nothnagle Drilling Inc.	**INSTALLATION DATE STARTED:** 10/16/2025	**DATE FINISHED:** 10/16/2025
INSTALLATION FOREMAN: Jason Earsing	**SAMPLE DATE STARTED:** 10/16/2025	**DATE FINISHED:** 10/16/2025
INSTALLATION EQUIPMENT: Geoprobe	**TYPE OF SAMPLING DEVICE:** 6-Liter Summa Canister	
INSPECTOR: Alyssa Barr	**SAMPLER:** Alyssa Barr	
POTENTIAL SAMPLE INTERFERENCES: None	**WEATHER CONDITIONS (PRECIP., TEMP., PRESS., WIND SPEED AND DIR.):** Temp: 36 - 54 F Wind: 9 - 17 mph NW Precipitation: 0% Pressure: 29.7	

METHOD OF INSTALLATION AND PURGING:

Nothnagle advanced a GeoProbe 6712DT to about 4 feet below grade surface (bgs) and installed the vapor point. The borehole was backfilled to about 3 feet bgs with No. 2 sand. The remainder of the borehole was sealed with hydrated bentonite. The flow controller was zeroed and valve opened to initiate the 2-hour sample. The sample and flow controller were checked every 30 minutes during sampling to ensure proper operation.

TUBING TYPE/DIAMETER: 3/8-inch OD by 1/4-inch ID polyethylene tubing	**TYPE OF MATERIAL ABOVE SEAL:** N/A
IMPLANT SCREEN TYPE/LENGTH/DIAMETER: 6-Inch Stainless Steel Probe	**SEAL MATERIAL (Bentonite, Beeswax, Modeling Clay, etc.):** Bentonite
BOREHOLE DIAMETER: 2 inches	**FILTER PACK MATERIAL (Sand or Glass Beads):** No. 2 Sand

PURGE VOLUME (L):	0.2	
PURGE FLOW RATE (ML/MIN):	0.2	
PID AFTER PURGE (PPM):	0.0	
HELIUM TESTS	Pre-sampling	Post-sampling
HELIUM TEST IN BUCKET(%):	16.8%	17.3%
HELIUM TEST IN TUBE (PPM):	0.0	0.0
SAMPLE START TIME:	14:32	
SAMPLE STOP TIME:	16:35	
TOTAL SAMPLE TIME (MIN):	123	
REGULATOR FLOW RATE (L/MIN):	0.04	
VOLUME OF SAMPLE (LITERS):	6	
PID AFTER SAMPLE (PPM):	0.0	
SAMPLE MOISTURE CONTENT:	N/A	
CAN SERIAL NUMBER:	3363	
REGULATOR SERIAL NUMBER:	02008	
CAN START VACUUM PRESS. (" HG):	-30.00	
CAN STOP VACUUM PRESS. (" HG):	-5.22	

IMPLANT/PROBE DETAILS (SEAL, FILTER, ETC.)		**DEPTH (FEET FROM SURFACE)**	**NOTES**
SURFACE / SURFACE	**Top of Seal**	0	
	Top of Pack	3	
	Tube Depth	4	

SAMPLE LOCATION SKETCH

See Sample Location Plan

NOTES

N/A

SOIL VAPOR POINT INSTALLATION/SAMPLING LOG SHEET

Location ID: P6SV10 Sample ID: P6SV10_101625

PROJECT: East Adams Redevelopment - Phase VI	**PROJECT NO.:** 170859701	
LOCATION: Syracuse, NY	**SURFACE ELEVATION AND DATUM:** N/A	
DRILLING FIRM OR LANGAN INSTALLER: Nothnagle Drilling Inc.	**INSTALLATION DATE STARTED:** 10/15/2025	**DATE FINISHED:** 10/15/2025
INSTALLATION FOREMAN: Jason Earsing	**SAMPLE DATE STARTED:** 10/16/2025	**DATE FINISHED:** 10/16/2025
INSTALLATION EQUIPMENT: Geoprobe	**TYPE OF SAMPLING DEVICE:** 6-Liter Summa Canister	
INSPECTOR: Alyssa Barr	**SAMPLER:** Alyssa Barr	
POTENTIAL SAMPLE INTERFERENCES: P6SV10 collected near sidewalk and roadway adjoining residential apartment complex. Group observed smoking in the area during the last 30 minutes of sampling.	**WEATHER CONDITIONS (PRECIP., TEMP., PRESS., WIND SPEED AND DIR.):** Temp: 36 - 54 F Wind: 9 - 17 mph NW Precipitation: 0% Pressure: 29.7	

METHOD OF INSTALLATION AND PURGING:

Nothnagle advanced a GeoProbe 6712DT to about 4 feet below grade surface (bgs) and installed the vapor point. The borehole was backfilled to about 3 feet bgs with No. 2 sand. The remainder of the borehole was sealed with hydrated bentonite. The flow controller was zeroed and valve opened to initiate the 2-hour sample. The sample and flow controller were checked every 30 minutes during sampling to ensure proper operation.

TUBING TYPE/DIAMETER: 3/8-inch OD by 1/4-inch ID polyethylene tubing	**TYPE OF MATERIAL ABOVE SEAL:** N/A
IMPLANT SCREEN TYPE/LENGTH/DIAMETER: 6-Inch Stainless Steel Probe	**SEAL MATERIAL (Bentonite, Beeswax, Modeling Clay, etc.):** Bentonite
BOREHOLE DIAMETER: 2 inches	**FILTER PACK MATERIAL (Sand or Glass Beads):** No. 2 Sand

PURGE VOLUME (L):	0.2	
PURGE FLOW RATE (ML/MIN):	0.2	
PID AFTER PURGE (PPM):	0.0	
HELIUM TESTS	Pre-sampling	Post-sampling
HELIUM TEST IN BUCKET(%):	18.5%	15.1%
HELIUM TEST IN TUBE (PPM):	0.0	0.0
SAMPLE START TIME:	14:16	
SAMPLE STOP TIME:	16:22	
TOTAL SAMPLE TIME (MIN):	126	
REGULATOR FLOW RATE (L/MIN):	0.04	
VOLUME OF SAMPLE (LITERS):	6	
PID AFTER SAMPLE (PPM):	0.0	
SAMPLE MOISTURE CONTENT:	N/A	
CAN SERIAL NUMBER:	1663	
REGULATOR SERIAL NUMBER:	01499	
CAN START VACUUM PRESS. (" HG):	-29.89	
CAN STOP VACUUM PRESS. (" HG):	-5.60	

IMPLANT/PROBE DETAILS (SEAL, FILTER, ETC.)	**DEPTH (FEET FROM SURFACE)**	**NOTES**
SURFACE / SURFACE		
Top of Seal	0	
Top of Pack	3	
Tube Depth	4	

SAMPLE LOCATION SKETCH

See Sample Location Plan

NOTES

N/A

AIR SAMPLING LOG SHEET

Location ID: P6AA01 Sample ID: P6AA01_101625

PROJECT: East Adams Redevelopment - Phase VI	**PROJECT NO.:** 170859701	
LOCATION: Syracuse, NY	**SURFACE ELEVATION AND DATUM:** N/A	
SAMPLER: Alyssa Barr	**SAMPLE DATE STARTED:** 10/16/2025	**DATE FINISHED:** 10/16/2025
INSPECTOR: Alyssa Barr	**TYPE OF SAMPLING DEVICE:** 6-Liter Summa Canister	
POTENTIAL SAMPLE INTERFERENCES: P6AA01 collected within active parking lot in apartment complex. Minimal vehicles observed coming and going during sampling period.	**WEATHER CONDITIONS (PRECIP., TEMP., PRESS., WIND SPEED AND DIR.):**	
	Temp:	36 - 54 F
	Wind:	10 - 17 mph NW
	Precipitation:	0%
	Pressure:	29.7

METHOD OF INSTALLATION AND SAMPLING:

Langan field screened the sample location with a MultiRAE multi-gas monitor prior to sampling. Sample consisted of a 6-liter Summa canister fitted with an 2-hour flow control valve. The flow controller was zeroed and valve opened to initiate the 2-hour sample collection. The sample and flow controller were checked every 30 minutes during sampling to ensure proper operation.

HEIGHT ABOVE GROUND (FT):	4
PID BEFORE SAMPLE (PPM):	0.0
SAMPLE START TIME:	14:00
SAMPLE STOP TIME:	15:57
TOTAL SAMPLE TIME (MIN):	117
REGULATOR FLOW RATE (L/MIN):	0.04
VOLUME OF SAMPLE (LITERS):	6
PID AFTER SAMPLE (PPM):	0.0
SAMPLE MOISTURE CONTENT:	N/A
CAN SERIAL NUMBER:	4301
REGULATOR SERIAL NUMBER:	2008
CAN START VACUUM PRESS. (" HG):	-30.00
CAN STOP VACUUM PRESS. (" HG):	-5.22

SAMPLE LOCATION SKETCH

See Sample Location Plan

NOTES

P6AA01 collected around breathing height approximately 3 feet south of P6SV02.

Langan Engineering, Environmental, Surveying, Landscape Architecture, and Geology D.P.C.
368 Ninth Avenue, 8th Floor, New York, New York 10001-2727

APPENDIX G

LABORATORY ANALYTICAL REPORTS

ANALYTICAL REPORT

Lab Number:	L2565313
Client:	Langan Engineering & Environmental 21 Penn Plaza 360 West 31st Street, 8th Floor New York, NY 10001-2727
ATTN:	Lexi Haley
Phone:	(212) 479-5499
Project Name:	EAST ADAMS REDEVELOPMENT PHVI
Project Number:	170859701
Report Date:	10/30/25

The original project report/data package is held by Pace Analytical Services. This report/data package is paginated and should be reproduced only in its entirety. Pace Analytical Services holds no responsibility for results and/or data that are not consistent with the original.

Certifications & Approvals: MA (M-MA086), NH NELAP (2064), CT (PH-0826), IL (200077), IN (C-MA-03), KY (KY98045), ME (MA00086), MD (348), NJ (MA935), NY (11148), NC (25700/666), OR (MA-1316), PA (68-03671), RI (LAO00065), TX (T104704476), VT (VT-0935), VA (460195), USDA (Permit #525-23-122-91930A1).

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565313
Report Date: 10/30/25

Lab Sample ID	Client ID	Matrix	Sample Location	Collection Date/Time	Receive Date
L2565313-01	P6SB03_1-2	SOIL	SYRACUSE NY	10/15/25 09:40	10/15/25
L2565313-02	P6SB03_4-5	SOIL	SYRACUSE NY	10/15/25 10:00	10/15/25
L2565313-03	P6SB04_0-1	SOIL	SYRACUSE NY	10/15/25 11:00	10/15/25
L2565313-04	P6SB04_4-5	SOIL	SYRACUSE NY	10/15/25 11:40	10/15/25
L2565313-05	P6SB10_0-1	SOIL	SYRACUSE NY	10/15/25 12:20	10/15/25
L2565313-06	P6SB10_2-3	SOIL	SYRACUSE NY	10/15/25 12:45	10/15/25
L2565313-07	P6SB07_1-2	SOIL	SYRACUSE NY	10/15/25 13:45	10/15/25
L2565313-08	P6SB07_2-3	SOIL	SYRACUSE NY	10/15/25 14:15	10/15/25
L2565313-09	P6SB06_0-1	SOIL	SYRACUSE NY	10/15/25 14:30	10/15/25
L2565313-10	P6SB06_3-4	SOIL	SYRACUSE NY	10/15/25 14:50	10/15/25

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565313
Project Number:	170859701	**Report Date:**	10/30/25

Case Narrative

The samples were received in accordance with the Chain of Custody and no significant deviations were encountered during the preparation or analysis unless otherwise noted. Sample Receipt, Container Information, and the Chain of Custody are located at the back of the report.

Results contained within this report relate only to the samples submitted under this Pace Lab Number and meet NELAP requirements for all NELAP accredited parameters unless otherwise noted in the following narrative. The data presented in this report is organized by parameter (i.e. VOC, SVOC, etc.). Sample specific Quality Control data (i.e. Surrogate Spike Recovery) is reported at the end of the target analyte list for each individual sample, followed by the Laboratory Batch Quality Control at the end of each parameter. Tentatively Identified Compounds (TICs), if requested, are reported for compounds identified to be present and are not part of the method/program Target Compound List, even if only a subset of the TCL are being reported. If a sample was re-analyzed or re-extracted due to a required quality control corrective action and if both sets of data are reported, the Laboratory ID of the re-analysis or re-extraction is designated with an "R" or "RE", respectively.

When multiple Batch Quality Control elements are reported (e.g. more than one LCS), the associated samples for each element are noted in the grey shaded header line of each data table. Any Laboratory Batch, Sample Specific % recovery or RPD value that is outside the listed Acceptance Criteria is bolded in the report. In reference to questions H (CAM) or 4 (RCP) when "NO" is checked, the performance criteria for CAM and RCP methods allow for some quality control failures to occur and still be within method compliance. In these instances, the specific failure is not narrated but noted in the associated QC Outlier Summary Report, located directly after the Case Narrative. QC information is also incorporated in the Data Usability Assessment table (Format 11) of our Data Merger tool, where it can be reviewed in conjunction with the sample result, associated regulatory criteria and any associated data usability implications.

Soil/sediments and solids are reported on a dry weight basis unless otherwise noted. Tissues are reported "as received" or on a wet weight basis, unless otherwise noted. Definitions of all data qualifiers and acronyms used in this report are provided in the Glossary located at the back of the report.

HOLD POLICY - For samples submitted on hold, Pace's policy is to hold samples (with the exception of Air canisters) free of charge for 21 calendar days from the date the project is completed. After 21 calendar days, we will dispose of all samples submitted including those put on hold unless you have contacted your Pace Project Manager and made arrangements for Pace to continue to hold the samples. Air canisters will be disposed after 3 business days from the date the project is completed.

Please contact Project Management at 800-624-9220 with any questions.

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565313
Project Number:	170859701	**Report Date:**	10/30/25

Case Narrative (continued)

Report Submission

October 30, 2025: This final report includes the results of all requested analyses.

October 29, 2025: This is a preliminary report. Please note that your project has contingency samples on hold. Contact your project manager to request additional analyses within 3 business days of receiving this report. Requests made after this time frame will be reported separately.

All non-detect (ND) or estimated concentrations (J-qualified) have been quantitated to the limit noted in the MDL column.

Volatile Organics

The WG2134398-5 Method Blank associated with L2565313-07 and -08 has a concentration above the reporting limit for chloroform. Since the associated sample concentrations are either greater than 10x the blank concentration or non-detect to the RL for this target analyte, no corrective action is required. Any results detected below the reporting limit are qualified with a "B".

Total Metals

L2565313-01 through -10: The sample has elevated detection limits for all elements, with the exception of mercury, due to the dilution required by the sample matrix.

The WG2130330-1 Method Blank associated with L2565313-10 has a concentration above the reporting limit for iron. Since the associated sample concentrations are either greater than 10x the blank concentration or non-detect to the RL for this target analyte, no corrective action is required. Any results detected below the reporting limit are qualified with a "B".

Chromium, Hexavalent

The WG2128644-2 LCS recovery associated with L2565313-01 through -10 is outside our in-house acceptance criteria for chromium, hexavalent (76%), but within the vendor-certified acceptance limits. The results of the original analysis are reported.

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565313
Project Number:	170859701	**Report Date:**	10/30/25

Case Narrative (continued)

Cyanide, Total

The WG2130558-2/-3 LCS/LCSD recoveries associated with L2565313-01 through -10 are outside our in-house acceptance criteria for cyanide, total (78%), but within the vendor-certified acceptance limits. The results of the original analysis are reported.

I, the undersigned, attest under the pains and penalties of perjury that, to the best of my knowledge and belief and based upon my personal inquiry of those responsible for providing the information contained in this analytical report, such information is accurate and complete. This certificate of analysis is not complete unless this page accompanies any and all pages of this report.

Authorized Signature: Kelly O'Neill

Title: Technical Director/Representative Date: 10/30/25

ORGANICS

VOLATILES

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-01
Client ID: P6SB03_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 09:40
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/25/25 16:00
Analyst: AJK
Percent Solids: 85%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	8.8	4.0	1
1,1-Dichloroethane	ND		ug/kg	1.8	0.26	1
Chloroform	ND		ug/kg	2.6	0.25	1
Carbon tetrachloride	ND		ug/kg	1.8	0.40	1
1,2-Dichloropropane	ND		ug/kg	1.8	0.22	1
Dibromochloromethane	ND		ug/kg	1.8	0.25	1
1,1,2-Trichloroethane	ND		ug/kg	1.8	0.47	1
Tetrachloroethene	ND		ug/kg	0.88	0.34	1
Chlorobenzene	ND		ug/kg	0.88	0.22	1
Trichlorofluoromethane	ND		ug/kg	7.0	1.2	1
1,2-Dichloroethane	ND		ug/kg	1.8	0.45	1
1,1,1-Trichloroethane	ND		ug/kg	0.88	0.29	1
Bromodichloromethane	ND		ug/kg	0.88	0.19	1
trans-1,3-Dichloropropene	ND		ug/kg	1.8	0.48	1
cis-1,3-Dichloropropene	ND		ug/kg	0.88	0.28	1
1,3-Dichloropropene, Total	ND		ug/kg	0.88	0.28	1
1,1-Dichloropropene	ND		ug/kg	0.88	0.28	1
Bromoform	ND		ug/kg	7.0	0.43	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.88	0.29	1
Benzene	ND		ug/kg	0.88	0.29	1
Toluene	ND		ug/kg	1.8	0.96	1
Ethylbenzene	ND		ug/kg	1.8	0.25	1
Chloromethane	ND		ug/kg	7.0	1.6	1
Bromomethane	ND		ug/kg	3.5	1.0	1
Vinyl chloride	ND		ug/kg	1.8	0.59	1
Chloroethane	ND		ug/kg	3.5	0.80	1
1,1-Dichloroethene	ND		ug/kg	1.8	0.42	1
trans-1,2-Dichloroethene	ND		ug/kg	2.6	0.24	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-01 Date Collected: 10/15/25 09:40

Client ID: P6SB03_1-2 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.88	0.24	1
1,2-Dichlorobenzene	ND		ug/kg	3.5	0.25	1
1,3-Dichlorobenzene	ND		ug/kg	3.5	0.26	1
1,4-Dichlorobenzene	ND		ug/kg	3.5	0.30	1
Methyl tert butyl ether	ND		ug/kg	3.5	0.35	1
p/m-Xylene	ND		ug/kg	3.5	0.99	1
o-Xylene	ND		ug/kg	1.8	0.51	1
Xylenes, Total	ND		ug/kg	1.8	0.51	1
cis-1,2-Dichloroethene	ND		ug/kg	1.8	0.31	1
1,2-Dichloroethene, Total	ND		ug/kg	1.8	0.24	1
Dibromomethane	ND		ug/kg	3.5	0.42	1
Styrene	ND		ug/kg	1.8	0.34	1
Dichlorodifluoromethane	ND		ug/kg	18	1.6	1
Acetone	ND		ug/kg	18	8.5	1
Carbon disulfide	ND		ug/kg	18	8.0	1
2-Butanone	ND		ug/kg	18	3.9	1
Vinyl acetate	ND		ug/kg	18	3.8	1
4-Methyl-2-pentanone	ND		ug/kg	18	2.2	1
1,2,3-Trichloropropane	ND		ug/kg	3.5	0.22	1
2-Hexanone	ND		ug/kg	18	2.1	1
Bromochloromethane	ND		ug/kg	3.5	0.36	1
2,2-Dichloropropane	ND		ug/kg	3.5	0.36	1
1,2-Dibromoethane	ND		ug/kg	1.8	0.49	1
1,3-Dichloropropane	ND		ug/kg	3.5	0.29	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.88	0.23	1
Bromobenzene	ND		ug/kg	3.5	0.26	1
n-Butylbenzene	ND		ug/kg	1.8	0.29	1
sec-Butylbenzene	ND		ug/kg	1.8	0.26	1
tert-Butylbenzene	ND		ug/kg	3.5	0.21	1
o-Chlorotoluene	ND		ug/kg	3.5	0.34	1
p-Chlorotoluene	ND		ug/kg	3.5	0.19	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	5.3	1.8	1
Hexachlorobutadiene	ND		ug/kg	7.0	0.30	1
Isopropylbenzene	ND		ug/kg	1.8	0.19	1
p-Isopropyltoluene	ND		ug/kg	1.8	0.19	1
Naphthalene	ND		ug/kg	7.0	1.1	1
Acrylonitrile	ND		ug/kg	7.0	2.0	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-01 Date Collected: 10/15/25 09:40

Client ID: P6SB03_1-2 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.8	0.30	1
1,2,3-Trichlorobenzene	ND		ug/kg	3.5	0.57	1
1,2,4-Trichlorobenzene	ND		ug/kg	3.5	0.48	1
1,3,5-Trimethylbenzene	ND		ug/kg	3.5	0.34	1
1,2,4-Trimethylbenzene	ND		ug/kg	3.5	0.59	1
1,4-Dioxane	ND		ug/kg	140	62.	1
p-Diethylbenzene	ND		ug/kg	3.5	0.31	1
p-Ethyltoluene	ND		ug/kg	3.5	0.68	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	3.5	0.34	1
Ethyl ether	ND		ug/kg	3.5	0.60	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	8.8	2.5	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**133**	Q	70-130
Toluene-d8	95		70-130
4-Bromofluorobenzene	92		70-130
Dibromofluoromethane	128		70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-02 Date Collected: 10/15/25 10:00
Client ID: P6SB03_4-5 Date Received: 10/15/25
Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/25/25 16:27
Analyst: AJK
Percent Solids: 88%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	7.3	3.3	1
1,1-Dichloroethane	ND		ug/kg	1.5	0.21	1
Chloroform	ND		ug/kg	2.2	0.20	1
Carbon tetrachloride	ND		ug/kg	1.5	0.34	1
1,2-Dichloropropane	ND		ug/kg	1.5	0.18	1
Dibromochloromethane	ND		ug/kg	1.5	0.20	1
1,1,2-Trichloroethane	ND		ug/kg	1.5	0.39	1
Tetrachloroethene	ND		ug/kg	0.73	0.29	1
Chlorobenzene	ND		ug/kg	0.73	0.18	1
Trichlorofluoromethane	ND		ug/kg	5.8	1.0	1
1,2-Dichloroethane	ND		ug/kg	1.5	0.38	1
1,1,1-Trichloroethane	ND		ug/kg	0.73	0.24	1
Bromodichloromethane	ND		ug/kg	0.73	0.16	1
trans-1,3-Dichloropropene	ND		ug/kg	1.5	0.40	1
cis-1,3-Dichloropropene	ND		ug/kg	0.73	0.23	1
1,3-Dichloropropene, Total	ND		ug/kg	0.73	0.23	1
1,1-Dichloropropene	ND		ug/kg	0.73	0.23	1
Bromoform	ND		ug/kg	5.8	0.36	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.73	0.24	1
Benzene	ND		ug/kg	0.73	0.24	1
Toluene	ND		ug/kg	1.5	0.79	1
Ethylbenzene	ND		ug/kg	1.5	0.21	1
Chloromethane	ND		ug/kg	5.8	1.4	1
Bromomethane	ND		ug/kg	2.9	0.85	1
Vinyl chloride	ND		ug/kg	1.5	0.49	1
Chloroethane	ND		ug/kg	2.9	0.66	1
1,1-Dichloroethene	ND		ug/kg	1.5	0.35	1
trans-1,2-Dichloroethene	ND		ug/kg	2.2	0.20	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-02 Date Collected: 10/15/25 10:00

Client ID: P6SB03_4-5 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.73	0.20	1
1,2-Dichlorobenzene	ND		ug/kg	2.9	0.21	1
1,3-Dichlorobenzene	ND		ug/kg	2.9	0.22	1
1,4-Dichlorobenzene	ND		ug/kg	2.9	0.25	1
Methyl tert butyl ether	ND		ug/kg	2.9	0.29	1
p/m-Xylene	ND		ug/kg	2.9	0.82	1
o-Xylene	ND		ug/kg	1.5	0.42	1
Xylenes, Total	ND		ug/kg	1.5	0.42	1
cis-1,2-Dichloroethene	ND		ug/kg	1.5	0.26	1
1,2-Dichloroethene, Total	ND		ug/kg	1.5	0.20	1
Dibromomethane	ND		ug/kg	2.9	0.35	1
Styrene	ND		ug/kg	1.5	0.29	1
Dichlorodifluoromethane	ND		ug/kg	15	1.3	1
Acetone	ND		ug/kg	15	7.0	1
Carbon disulfide	ND		ug/kg	15	6.6	1
2-Butanone	ND		ug/kg	15	3.2	1
Vinyl acetate	ND		ug/kg	15	3.1	1
4-Methyl-2-pentanone	ND		ug/kg	15	1.9	1
1,2,3-Trichloropropane	ND		ug/kg	2.9	0.18	1
2-Hexanone	ND		ug/kg	15	1.7	1
Bromochloromethane	ND		ug/kg	2.9	0.30	1
2,2-Dichloropropane	ND		ug/kg	2.9	0.30	1
1,2-Dibromoethane	ND		ug/kg	1.5	0.41	1
1,3-Dichloropropane	ND		ug/kg	2.9	0.24	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.73	0.19	1
Bromobenzene	ND		ug/kg	2.9	0.21	1
n-Butylbenzene	ND		ug/kg	1.5	0.24	1
sec-Butylbenzene	ND		ug/kg	1.5	0.21	1
tert-Butylbenzene	ND		ug/kg	2.9	0.17	1
o-Chlorotoluene	ND		ug/kg	2.9	0.28	1
p-Chlorotoluene	ND		ug/kg	2.9	0.16	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	4.4	1.4	1
Hexachlorobutadiene	ND		ug/kg	5.8	0.25	1
Isopropylbenzene	ND		ug/kg	1.5	0.16	1
p-Isopropyltoluene	ND		ug/kg	1.5	0.16	1
Naphthalene	ND		ug/kg	5.8	0.95	1
Acrylonitrile	ND		ug/kg	5.8	1.7	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-02 Date Collected: 10/15/25 10:00

Client ID: P6SB03_4-5 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.5	0.25	1
1,2,3-Trichlorobenzene	ND		ug/kg	2.9	0.47	1
1,2,4-Trichlorobenzene	ND		ug/kg	2.9	0.40	1
1,3,5-Trimethylbenzene	ND		ug/kg	2.9	0.28	1
1,2,4-Trimethylbenzene	ND		ug/kg	2.9	0.49	1
1,4-Dioxane	ND		ug/kg	120	51.	1
p-Diethylbenzene	ND		ug/kg	2.9	0.26	1
p-Ethyltoluene	ND		ug/kg	2.9	0.56	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	2.9	0.28	1
Ethyl ether	ND		ug/kg	2.9	0.50	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	7.3	2.1	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**132**	Q	70-130
Toluene-d8	95		70-130
4-Bromofluorobenzene	88		70-130
Dibromofluoromethane	130		70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-03 Date Collected: 10/15/25 11:00
Client ID: P6SB04_0-1 Date Received: 10/15/25
Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/25/25 16:54
Analyst: AJK
Percent Solids: 83%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	9.6	4.4	1
1,1-Dichloroethane	ND		ug/kg	1.9	0.28	1
Chloroform	ND		ug/kg	2.9	0.27	1
Carbon tetrachloride	ND		ug/kg	1.9	0.44	1
1,2-Dichloropropane	ND		ug/kg	1.9	0.24	1
Dibromochloromethane	ND		ug/kg	1.9	0.27	1
1,1,2-Trichloroethane	ND		ug/kg	1.9	0.51	1
Tetrachloroethene	ND		ug/kg	0.96	0.38	1
Chlorobenzene	ND		ug/kg	0.96	0.24	1
Trichlorofluoromethane	ND		ug/kg	7.7	1.3	1
1,2-Dichloroethane	ND		ug/kg	1.9	0.50	1
1,1,1-Trichloroethane	ND		ug/kg	0.96	0.32	1
Bromodichloromethane	ND		ug/kg	0.96	0.21	1
trans-1,3-Dichloropropene	ND		ug/kg	1.9	0.53	1
cis-1,3-Dichloropropene	ND		ug/kg	0.96	0.30	1
1,3-Dichloropropene, Total	ND		ug/kg	0.96	0.30	1
1,1-Dichloropropene	ND		ug/kg	0.96	0.31	1
Bromoform	ND		ug/kg	7.7	0.47	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.96	0.32	1
Benzene	ND		ug/kg	0.96	0.32	1
Toluene	ND		ug/kg	1.9	1.0	1
Ethylbenzene	ND		ug/kg	1.9	0.27	1
Chloromethane	ND		ug/kg	7.7	1.8	1
Bromomethane	ND		ug/kg	3.8	1.1	1
Vinyl chloride	ND		ug/kg	1.9	0.65	1
Chloroethane	ND		ug/kg	3.8	0.87	1
1,1-Dichloroethene	ND		ug/kg	1.9	0.46	1
trans-1,2-Dichloroethene	ND		ug/kg	2.9	0.26	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-03 Date Collected: 10/15/25 11:00

Client ID: P6SB04_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.96	0.26	1
1,2-Dichlorobenzene	ND		ug/kg	3.8	0.28	1
1,3-Dichlorobenzene	ND		ug/kg	3.8	0.28	1
1,4-Dichlorobenzene	ND		ug/kg	3.8	0.33	1
Methyl tert butyl ether	ND		ug/kg	3.8	0.39	1
p/m-Xylene	ND		ug/kg	3.8	1.1	1
o-Xylene	ND		ug/kg	1.9	0.56	1
Xylenes, Total	ND		ug/kg	1.9	0.56	1
cis-1,2-Dichloroethene	ND		ug/kg	1.9	0.34	1
1,2-Dichloroethene, Total	ND		ug/kg	1.9	0.26	1
Dibromomethane	ND		ug/kg	3.8	0.46	1
Styrene	ND		ug/kg	1.9	0.38	1
Dichlorodifluoromethane	ND		ug/kg	19	1.8	1
Acetone	ND		ug/kg	19	9.3	1
Carbon disulfide	ND		ug/kg	19	8.8	1
2-Butanone	ND		ug/kg	19	4.3	1
Vinyl acetate	ND		ug/kg	19	4.1	1
4-Methyl-2-pentanone	ND		ug/kg	19	2.5	1
1,2,3-Trichloropropane	ND		ug/kg	3.8	0.24	1
2-Hexanone	ND		ug/kg	19	2.3	1
Bromochloromethane	ND		ug/kg	3.8	0.40	1
2,2-Dichloropropane	ND		ug/kg	3.8	0.39	1
1,2-Dibromoethane	ND		ug/kg	1.9	0.54	1
1,3-Dichloropropane	ND		ug/kg	3.8	0.32	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.96	0.25	1
Bromobenzene	ND		ug/kg	3.8	0.28	1
n-Butylbenzene	ND		ug/kg	1.9	0.32	1
sec-Butylbenzene	ND		ug/kg	1.9	0.28	1
tert-Butylbenzene	ND		ug/kg	3.8	0.23	1
o-Chlorotoluene	ND		ug/kg	3.8	0.37	1
p-Chlorotoluene	ND		ug/kg	3.8	0.21	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	5.8	1.9	1
Hexachlorobutadiene	ND		ug/kg	7.7	0.32	1
Isopropylbenzene	ND		ug/kg	1.9	0.21	1
p-Isopropyltoluene	ND		ug/kg	1.9	0.21	1
Naphthalene	ND		ug/kg	7.7	1.2	1
Acrylonitrile	ND		ug/kg	7.7	2.2	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-03 Date Collected: 10/15/25 11:00

Client ID: P6SB04_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.9	0.33	1
1,2,3-Trichlorobenzene	ND		ug/kg	3.8	0.62	1
1,2,4-Trichlorobenzene	ND		ug/kg	3.8	0.52	1
1,3,5-Trimethylbenzene	ND		ug/kg	3.8	0.37	1
1,2,4-Trimethylbenzene	ND		ug/kg	3.8	0.64	1
1,4-Dioxane	ND		ug/kg	150	68.	1
p-Diethylbenzene	ND		ug/kg	3.8	0.34	1
p-Ethyltoluene	ND		ug/kg	3.8	0.74	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	3.8	0.37	1
Ethyl ether	ND		ug/kg	3.8	0.66	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	9.6	2.7	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**131**	Q	70-130
Toluene-d8	98		70-130
4-Bromofluorobenzene	91		70-130
Dibromofluoromethane	127		70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-04
Client ID: P6SB04_4-5
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 11:40
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/25/25 17:22
Analyst: AJK
Percent Solids: 76%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	7.6	3.5	1
1,1-Dichloroethane	ND		ug/kg	1.5	0.22	1
Chloroform	ND		ug/kg	2.3	0.21	1
Carbon tetrachloride	ND		ug/kg	1.5	0.35	1
1,2-Dichloropropane	ND		ug/kg	1.5	0.19	1
Dibromochloromethane	ND		ug/kg	1.5	0.21	1
1,1,2-Trichloroethane	ND		ug/kg	1.5	0.41	1
Tetrachloroethene	ND		ug/kg	0.76	0.30	1
Chlorobenzene	ND		ug/kg	0.76	0.19	1
Trichlorofluoromethane	ND		ug/kg	6.1	1.1	1
1,2-Dichloroethane	ND		ug/kg	1.5	0.39	1
1,1,1-Trichloroethane	ND		ug/kg	0.76	0.25	1
Bromodichloromethane	ND		ug/kg	0.76	0.17	1
trans-1,3-Dichloropropene	ND		ug/kg	1.5	0.42	1
cis-1,3-Dichloropropene	ND		ug/kg	0.76	0.24	1
1,3-Dichloropropene, Total	ND		ug/kg	0.76	0.24	1
1,1-Dichloropropene	ND		ug/kg	0.76	0.24	1
Bromoform	ND		ug/kg	6.1	0.38	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.76	0.25	1
Benzene	ND		ug/kg	0.76	0.25	1
Toluene	ND		ug/kg	1.5	0.83	1
Ethylbenzene	ND		ug/kg	1.5	0.22	1
Chloromethane	ND		ug/kg	6.1	1.4	1
Bromomethane	ND		ug/kg	3.0	0.89	1
Vinyl chloride	ND		ug/kg	1.5	0.51	1
Chloroethane	ND		ug/kg	3.0	0.69	1
1,1-Dichloroethene	ND		ug/kg	1.5	0.36	1
trans-1,2-Dichloroethene	ND		ug/kg	2.3	0.21	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-04 Date Collected: 10/15/25 11:40

Client ID: P6SB04_4-5 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.76	0.21	1
1,2-Dichlorobenzene	ND		ug/kg	3.0	0.22	1
1,3-Dichlorobenzene	ND		ug/kg	3.0	0.22	1
1,4-Dichlorobenzene	ND		ug/kg	3.0	0.26	1
Methyl tert butyl ether	ND		ug/kg	3.0	0.31	1
p/m-Xylene	ND		ug/kg	3.0	0.85	1
o-Xylene	ND		ug/kg	1.5	0.44	1
Xylenes, Total	ND		ug/kg	1.5	0.44	1
cis-1,2-Dichloroethene	ND		ug/kg	1.5	0.27	1
1,2-Dichloroethene, Total	ND		ug/kg	1.5	0.21	1
Dibromomethane	ND		ug/kg	3.0	0.36	1
Styrene	ND		ug/kg	1.5	0.30	1
Dichlorodifluoromethane	ND		ug/kg	15	1.4	1
Acetone	ND		ug/kg	15	7.3	1
Carbon disulfide	ND		ug/kg	15	6.9	1
2-Butanone	ND		ug/kg	15	3.4	1
Vinyl acetate	ND		ug/kg	15	3.3	1
4-Methyl-2-pentanone	ND		ug/kg	15	2.0	1
1,2,3-Trichloropropane	ND		ug/kg	3.0	0.19	1
2-Hexanone	ND		ug/kg	15	1.8	1
Bromochloromethane	ND		ug/kg	3.0	0.31	1
2,2-Dichloropropane	ND		ug/kg	3.0	0.31	1
1,2-Dibromoethane	ND		ug/kg	1.5	0.42	1
1,3-Dichloropropane	ND		ug/kg	3.0	0.25	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.76	0.20	1
Bromobenzene	ND		ug/kg	3.0	0.22	1
n-Butylbenzene	ND		ug/kg	1.5	0.25	1
sec-Butylbenzene	ND		ug/kg	1.5	0.22	1
tert-Butylbenzene	ND		ug/kg	3.0	0.18	1
o-Chlorotoluene	ND		ug/kg	3.0	0.29	1
p-Chlorotoluene	ND		ug/kg	3.0	0.16	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	4.6	1.5	1
Hexachlorobutadiene	ND		ug/kg	6.1	0.26	1
Isopropylbenzene	ND		ug/kg	1.5	0.17	1
p-Isopropyltoluene	ND		ug/kg	1.5	0.17	1
Naphthalene	ND		ug/kg	6.1	0.99	1
Acrylonitrile	ND		ug/kg	6.1	1.8	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-04 Date Collected: 10/15/25 11:40

Client ID: P6SB04_4-5 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.5	0.26	1
1,2,3-Trichlorobenzene	ND		ug/kg	3.0	0.49	1
1,2,4-Trichlorobenzene	ND		ug/kg	3.0	0.42	1
1,3,5-Trimethylbenzene	ND		ug/kg	3.0	0.29	1
1,2,4-Trimethylbenzene	ND		ug/kg	3.0	0.51	1
1,4-Dioxane	ND		ug/kg	120	54.	1
p-Diethylbenzene	ND		ug/kg	3.0	0.27	1
p-Ethyltoluene	ND		ug/kg	3.0	0.58	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	3.0	0.29	1
Ethyl ether	ND		ug/kg	3.0	0.52	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	7.6	2.2	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**137**	Q	70-130
Toluene-d8	99		70-130
4-Bromofluorobenzene	91		70-130
Dibromofluoromethane	**133**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-05
Client ID: P6SB10_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 12:20
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/25/25 17:49
Analyst: AJK
Percent Solids: 89%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	6.9	3.2	1
1,1-Dichloroethane	ND		ug/kg	1.4	0.20	1
Chloroform	ND		ug/kg	2.1	0.19	1
Carbon tetrachloride	ND		ug/kg	1.4	0.32	1
1,2-Dichloropropane	ND		ug/kg	1.4	0.17	1
Dibromochloromethane	ND		ug/kg	1.4	0.19	1
1,1,2-Trichloroethane	ND		ug/kg	1.4	0.37	1
Tetrachloroethene	ND		ug/kg	0.69	0.27	1
Chlorobenzene	ND		ug/kg	0.69	0.18	1
Trichlorofluoromethane	ND		ug/kg	5.5	0.96	1
1,2-Dichloroethane	ND		ug/kg	1.4	0.35	1
1,1,1-Trichloroethane	ND		ug/kg	0.69	0.23	1
Bromodichloromethane	ND		ug/kg	0.69	0.15	1
trans-1,3-Dichloropropene	ND		ug/kg	1.4	0.38	1
cis-1,3-Dichloropropene	ND		ug/kg	0.69	0.22	1
1,3-Dichloropropene, Total	ND		ug/kg	0.69	0.22	1
1,1-Dichloropropene	ND		ug/kg	0.69	0.22	1
Bromoform	ND		ug/kg	5.5	0.34	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.69	0.23	1
Benzene	ND		ug/kg	0.69	0.23	1
Toluene	ND		ug/kg	1.4	0.75	1
Ethylbenzene	ND		ug/kg	1.4	0.19	1
Chloromethane	ND		ug/kg	5.5	1.3	1
Bromomethane	ND		ug/kg	2.8	0.80	1
Vinyl chloride	ND		ug/kg	1.4	0.46	1
Chloroethane	ND		ug/kg	2.8	0.62	1
1,1-Dichloroethene	ND		ug/kg	1.4	0.33	1
trans-1,2-Dichloroethene	ND		ug/kg	2.1	0.19	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-05 Date Collected: 10/15/25 12:20

Client ID: P6SB10_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.69	0.19	1
1,2-Dichlorobenzene	ND		ug/kg	2.8	0.20	1
1,3-Dichlorobenzene	ND		ug/kg	2.8	0.20	1
1,4-Dichlorobenzene	ND		ug/kg	2.8	0.24	1
Methyl tert butyl ether	ND		ug/kg	2.8	0.28	1
p/m-Xylene	ND		ug/kg	2.8	0.77	1
o-Xylene	ND		ug/kg	1.4	0.40	1
Xylenes, Total	ND		ug/kg	1.4	0.40	1
cis-1,2-Dichloroethene	ND		ug/kg	1.4	0.24	1
1,2-Dichloroethene, Total	ND		ug/kg	1.4	0.19	1
Dibromomethane	ND		ug/kg	2.8	0.33	1
Styrene	ND		ug/kg	1.4	0.27	1
Dichlorodifluoromethane	ND		ug/kg	14	1.3	1
Acetone	ND		ug/kg	14	6.6	1
Carbon disulfide	ND		ug/kg	14	6.3	1
2-Butanone	ND		ug/kg	14	3.1	1
Vinyl acetate	ND		ug/kg	14	3.0	1
4-Methyl-2-pentanone	ND		ug/kg	14	1.8	1
1,2,3-Trichloropropane	ND		ug/kg	2.8	0.18	1
2-Hexanone	ND		ug/kg	14	1.6	1
Bromochloromethane	ND		ug/kg	2.8	0.28	1
2,2-Dichloropropane	ND		ug/kg	2.8	0.28	1
1,2-Dibromoethane	ND		ug/kg	1.4	0.38	1
1,3-Dichloropropane	ND		ug/kg	2.8	0.23	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.69	0.18	1
Bromobenzene	ND		ug/kg	2.8	0.20	1
n-Butylbenzene	ND		ug/kg	1.4	0.23	1
sec-Butylbenzene	ND		ug/kg	1.4	0.20	1
tert-Butylbenzene	ND		ug/kg	2.8	0.16	1
o-Chlorotoluene	ND		ug/kg	2.8	0.26	1
p-Chlorotoluene	ND		ug/kg	2.8	0.15	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	4.1	1.4	1
Hexachlorobutadiene	ND		ug/kg	5.5	0.23	1
Isopropylbenzene	ND		ug/kg	1.4	0.15	1
p-Isopropyltoluene	ND		ug/kg	1.4	0.15	1
Naphthalene	ND		ug/kg	5.5	0.90	1
Acrylonitrile	ND		ug/kg	5.5	1.6	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-05 Date Collected: 10/15/25 12:20

Client ID: P6SB10_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.4	0.24	1
1,2,3-Trichlorobenzene	ND		ug/kg	2.8	0.44	1
1,2,4-Trichlorobenzene	ND		ug/kg	2.8	0.38	1
1,3,5-Trimethylbenzene	ND		ug/kg	2.8	0.27	1
1,2,4-Trimethylbenzene	ND		ug/kg	2.8	0.46	1
1,4-Dioxane	ND		ug/kg	110	48.	1
p-Diethylbenzene	ND		ug/kg	2.8	0.24	1
p-Ethyltoluene	ND		ug/kg	2.8	0.53	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	2.8	0.26	1
Ethyl ether	ND		ug/kg	2.8	0.47	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	6.9	2.0	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**136**	Q	70-130
Toluene-d8	100		70-130
4-Bromofluorobenzene	93		70-130
Dibromofluoromethane	130		70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-06 Date Collected: 10/15/25 12:45
Client ID: P6SB10_2-3 Date Received: 10/15/25
Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/25/25 18:17
Analyst: AJK
Percent Solids: 87%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	5.8	2.6	1
1,1-Dichloroethane	ND		ug/kg	1.2	0.17	1
Chloroform	ND		ug/kg	1.7	0.16	1
Carbon tetrachloride	ND		ug/kg	1.2	0.26	1
1,2-Dichloropropane	ND		ug/kg	1.2	0.14	1
Dibromochloromethane	ND		ug/kg	1.2	0.16	1
1,1,2-Trichloroethane	ND		ug/kg	1.2	0.31	1
Tetrachloroethene	ND		ug/kg	0.58	0.22	1
Chlorobenzene	ND		ug/kg	0.58	0.15	1
Trichlorofluoromethane	ND		ug/kg	4.6	0.80	1
1,2-Dichloroethane	ND		ug/kg	1.2	0.30	1
1,1,1-Trichloroethane	ND		ug/kg	0.58	0.19	1
Bromodichloromethane	ND		ug/kg	0.58	0.12	1
trans-1,3-Dichloropropene	ND		ug/kg	1.2	0.31	1
cis-1,3-Dichloropropene	ND		ug/kg	0.58	0.18	1
1,3-Dichloropropene, Total	ND		ug/kg	0.58	0.18	1
1,1-Dichloropropene	ND		ug/kg	0.58	0.18	1
Bromoform	ND		ug/kg	4.6	0.28	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.58	0.19	1
Benzene	ND		ug/kg	0.58	0.19	1
Toluene	ND		ug/kg	1.2	0.62	1
Ethylbenzene	ND		ug/kg	1.2	0.16	1
Chloromethane	ND		ug/kg	4.6	1.1	1
Bromomethane	ND		ug/kg	2.3	0.67	1
Vinyl chloride	ND		ug/kg	1.2	0.38	1
Chloroethane	ND		ug/kg	2.3	0.52	1
1,1-Dichloroethene	ND		ug/kg	1.2	0.27	1
trans-1,2-Dichloroethene	ND		ug/kg	1.7	0.16	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-06 Date Collected: 10/15/25 12:45

Client ID: P6SB10_2-3 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.58	0.16	1
1,2-Dichlorobenzene	ND		ug/kg	2.3	0.16	1
1,3-Dichlorobenzene	ND		ug/kg	2.3	0.17	1
1,4-Dichlorobenzene	ND		ug/kg	2.3	0.20	1
Methyl tert butyl ether	ND		ug/kg	2.3	0.23	1
p/m-Xylene	ND		ug/kg	2.3	0.64	1
o-Xylene	ND		ug/kg	1.2	0.34	1
Xylenes, Total	ND		ug/kg	1.2	0.34	1
cis-1,2-Dichloroethene	ND		ug/kg	1.2	0.20	1
1,2-Dichloroethene, Total	ND		ug/kg	1.2	0.16	1
Dibromomethane	ND		ug/kg	2.3	0.27	1
Styrene	ND		ug/kg	1.2	0.22	1
Dichlorodifluoromethane	ND		ug/kg	12	1.0	1
Acetone	ND		ug/kg	12	5.5	1
Carbon disulfide	ND		ug/kg	12	5.2	1
2-Butanone	ND		ug/kg	12	2.6	1
Vinyl acetate	ND		ug/kg	12	2.5	1
4-Methyl-2-pentanone	ND		ug/kg	12	1.5	1
1,2,3-Trichloropropane	ND		ug/kg	2.3	0.15	1
2-Hexanone	ND		ug/kg	12	1.4	1
Bromochloromethane	ND		ug/kg	2.3	0.24	1
2,2-Dichloropropane	ND		ug/kg	2.3	0.23	1
1,2-Dibromoethane	ND		ug/kg	1.2	0.32	1
1,3-Dichloropropane	ND		ug/kg	2.3	0.19	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.58	0.15	1
Bromobenzene	ND		ug/kg	2.3	0.17	1
n-Butylbenzene	ND		ug/kg	1.2	0.19	1
sec-Butylbenzene	ND		ug/kg	1.2	0.17	1
tert-Butylbenzene	ND		ug/kg	2.3	0.14	1
o-Chlorotoluene	ND		ug/kg	2.3	0.22	1
p-Chlorotoluene	ND		ug/kg	2.3	0.12	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	3.4	1.1	1
Hexachlorobutadiene	ND		ug/kg	4.6	0.19	1
Isopropylbenzene	ND		ug/kg	1.2	0.12	1
p-Isopropyltoluene	ND		ug/kg	1.2	0.12	1
Naphthalene	ND		ug/kg	4.6	0.75	1
Acrylonitrile	ND		ug/kg	4.6	1.3	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-06 Date Collected: 10/15/25 12:45

Client ID: P6SB10_2-3 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.2	0.20	1
1,2,3-Trichlorobenzene	ND		ug/kg	2.3	0.37	1
1,2,4-Trichlorobenzene	ND		ug/kg	2.3	0.31	1
1,3,5-Trimethylbenzene	ND		ug/kg	2.3	0.22	1
1,2,4-Trimethylbenzene	ND		ug/kg	2.3	0.38	1
1,4-Dioxane	ND		ug/kg	92	40.	1
p-Diethylbenzene	ND		ug/kg	2.3	0.20	1
p-Ethyltoluene	ND		ug/kg	2.3	0.44	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	2.3	0.22	1
Ethyl ether	ND		ug/kg	2.3	0.39	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	5.8	1.6	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**133**	Q	70-130
Toluene-d8	98		70-130
4-Bromofluorobenzene	90		70-130
Dibromofluoromethane	130		70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-07 Date Collected: 10/15/25 13:45
Client ID: P6SB07_1-2 Date Received: 10/15/25
Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/28/25 13:42
Analyst: AJK
Percent Solids: 84%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	7.6	3.4	1
1,1-Dichloroethane	ND		ug/kg	1.5	0.22	1
Chloroform	0.42	JB	ug/kg	2.3	0.21	1
Carbon tetrachloride	ND		ug/kg	1.5	0.35	1
1,2-Dichloropropane	ND		ug/kg	1.5	0.19	1
Dibromochloromethane	ND		ug/kg	1.5	0.21	1
1,1,2-Trichloroethane	ND		ug/kg	1.5	0.40	1
Tetrachloroethene	0.79		ug/kg	0.76	0.30	1
Chlorobenzene	ND		ug/kg	0.76	0.19	1
Trichlorofluoromethane	ND		ug/kg	6.0	1.0	1
1,2-Dichloroethane	ND		ug/kg	1.5	0.39	1
1,1,1-Trichloroethane	ND		ug/kg	0.76	0.25	1
Bromodichloromethane	ND		ug/kg	0.76	0.16	1
trans-1,3-Dichloropropene	ND		ug/kg	1.5	0.41	1
cis-1,3-Dichloropropene	ND		ug/kg	0.76	0.24	1
1,3-Dichloropropene, Total	ND		ug/kg	0.76	0.24	1
1,1-Dichloropropene	ND		ug/kg	0.76	0.24	1
Bromoform	ND		ug/kg	6.0	0.37	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.76	0.25	1
Benzene	ND		ug/kg	0.76	0.25	1
Toluene	ND		ug/kg	1.5	0.82	1
Ethylbenzene	ND		ug/kg	1.5	0.21	1
Chloromethane	ND		ug/kg	6.0	1.4	1
Bromomethane	ND		ug/kg	3.0	0.88	1
Vinyl chloride	ND		ug/kg	1.5	0.50	1
Chloroethane	ND		ug/kg	3.0	0.68	1
1,1-Dichloroethene	ND		ug/kg	1.5	0.36	1
trans-1,2-Dichloroethene	ND		ug/kg	2.3	0.21	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-07 Date Collected: 10/15/25 13:45

Client ID: P6SB07_1-2 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.76	0.21	1
1,2-Dichlorobenzene	ND		ug/kg	3.0	0.22	1
1,3-Dichlorobenzene	ND		ug/kg	3.0	0.22	1
1,4-Dichlorobenzene	ND		ug/kg	3.0	0.26	1
Methyl tert butyl ether	ND		ug/kg	3.0	0.30	1
p/m-Xylene	ND		ug/kg	3.0	0.84	1
o-Xylene	ND		ug/kg	1.5	0.44	1
Xylenes, Total	ND		ug/kg	1.5	0.44	1
cis-1,2-Dichloroethene	ND		ug/kg	1.5	0.26	1
1,2-Dichloroethene, Total	ND		ug/kg	1.5	0.21	1
Dibromomethane	ND		ug/kg	3.0	0.36	1
Styrene	ND		ug/kg	1.5	0.30	1
Dichlorodifluoromethane	ND		ug/kg	15	1.4	1
Acetone	ND		ug/kg	15	7.3	1
Carbon disulfide	ND		ug/kg	15	6.9	1
2-Butanone	ND		ug/kg	15	3.4	1
Vinyl acetate	ND		ug/kg	15	3.2	1
4-Methyl-2-pentanone	ND		ug/kg	15	1.9	1
1,2,3-Trichloropropane	ND		ug/kg	3.0	0.19	1
2-Hexanone	ND		ug/kg	15	1.8	1
Bromochloromethane	ND		ug/kg	3.0	0.31	1
2,2-Dichloropropane	ND		ug/kg	3.0	0.30	1
1,2-Dibromoethane	ND		ug/kg	1.5	0.42	1
1,3-Dichloropropane	ND		ug/kg	3.0	0.25	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.76	0.20	1
Bromobenzene	ND		ug/kg	3.0	0.22	1
n-Butylbenzene	ND		ug/kg	1.5	0.25	1
sec-Butylbenzene	ND		ug/kg	1.5	0.22	1
tert-Butylbenzene	ND		ug/kg	3.0	0.18	1
o-Chlorotoluene	ND		ug/kg	3.0	0.29	1
p-Chlorotoluene	ND		ug/kg	3.0	0.16	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	4.5	1.5	1
Hexachlorobutadiene	ND		ug/kg	6.0	0.26	1
Isopropylbenzene	ND		ug/kg	1.5	0.16	1
p-Isopropyltoluene	ND		ug/kg	1.5	0.16	1
Naphthalene	ND		ug/kg	6.0	0.98	1
Acrylonitrile	ND		ug/kg	6.0	1.7	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-07 Date Collected: 10/15/25 13:45

Client ID: P6SB07_1-2 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.5	0.26	1
1,2,3-Trichlorobenzene	ND		ug/kg	3.0	0.49	1
1,2,4-Trichlorobenzene	ND		ug/kg	3.0	0.41	1
1,3,5-Trimethylbenzene	ND		ug/kg	3.0	0.29	1
1,2,4-Trimethylbenzene	ND		ug/kg	3.0	0.50	1
1,4-Dioxane	ND		ug/kg	120	53.	1
p-Diethylbenzene	ND		ug/kg	3.0	0.27	1
p-Ethyltoluene	ND		ug/kg	3.0	0.58	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	3.0	0.29	1
Ethyl ether	ND		ug/kg	3.0	0.52	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	7.6	2.1	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	122		70-130
Toluene-d8	96		70-130
4-Bromofluorobenzene	92		70-130
Dibromofluoromethane	121		70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-08 Date Collected: 10/15/25 14:15
Client ID: P6SB07_2-3 Date Received: 10/15/25
Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/28/25 14:10
Analyst: AJK
Percent Solids: 84%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	9.3	4.2	1
1,1-Dichloroethane	ND		ug/kg	1.8	0.27	1
Chloroform	0.43	JB	ug/kg	2.8	0.26	1
Carbon tetrachloride	ND		ug/kg	1.8	0.43	1
1,2-Dichloropropane	ND		ug/kg	1.8	0.23	1
Dibromochloromethane	ND		ug/kg	1.8	0.26	1
1,1,2-Trichloroethane	ND		ug/kg	1.8	0.50	1
Tetrachloroethene	2.8		ug/kg	0.93	0.36	1
Chlorobenzene	ND		ug/kg	0.93	0.24	1
Trichlorofluoromethane	ND		ug/kg	7.4	1.3	1
1,2-Dichloroethane	ND		ug/kg	1.8	0.48	1
1,1,1-Trichloroethane	ND		ug/kg	0.93	0.31	1
Bromodichloromethane	ND		ug/kg	0.93	0.20	1
trans-1,3-Dichloropropene	ND		ug/kg	1.8	0.51	1
cis-1,3-Dichloropropene	ND		ug/kg	0.93	0.29	1
1,3-Dichloropropene, Total	ND		ug/kg	0.93	0.29	1
1,1-Dichloropropene	ND		ug/kg	0.93	0.29	1
Bromoform	ND		ug/kg	7.4	0.46	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.93	0.31	1
Benzene	ND		ug/kg	0.93	0.31	1
Toluene	ND		ug/kg	1.8	1.0	1
Ethylbenzene	ND		ug/kg	1.8	0.26	1
Chloromethane	ND		ug/kg	7.4	1.7	1
Bromomethane	ND		ug/kg	3.7	1.1	1
Vinyl chloride	ND		ug/kg	1.8	0.62	1
Chloroethane	ND		ug/kg	3.7	0.84	1
1,1-Dichloroethene	ND		ug/kg	1.8	0.44	1
trans-1,2-Dichloroethene	ND		ug/kg	2.8	0.25	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-08 Date Collected: 10/15/25 14:15

Client ID: P6SB07_2-3 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.93	0.25	1
1,2-Dichlorobenzene	ND		ug/kg	3.7	0.27	1
1,3-Dichlorobenzene	ND		ug/kg	3.7	0.27	1
1,4-Dichlorobenzene	ND		ug/kg	3.7	0.32	1
Methyl tert butyl ether	ND		ug/kg	3.7	0.37	1
p/m-Xylene	ND		ug/kg	3.7	1.0	1
o-Xylene	ND		ug/kg	1.8	0.54	1
Xylenes, Total	ND		ug/kg	1.8	0.54	1
cis-1,2-Dichloroethene	ND		ug/kg	1.8	0.32	1
1,2-Dichloroethene, Total	ND		ug/kg	1.8	0.25	1
Dibromomethane	ND		ug/kg	3.7	0.44	1
Styrene	ND		ug/kg	1.8	0.36	1
Dichlorodifluoromethane	ND		ug/kg	18	1.7	1
Acetone	ND		ug/kg	18	8.9	1
Carbon disulfide	ND		ug/kg	18	8.4	1
2-Butanone	ND		ug/kg	18	4.1	1
Vinyl acetate	ND		ug/kg	18	4.0	1
4-Methyl-2-pentanone	ND		ug/kg	18	2.4	1
1,2,3-Trichloropropane	ND		ug/kg	3.7	0.24	1
2-Hexanone	ND		ug/kg	18	2.2	1
Bromochloromethane	ND		ug/kg	3.7	0.38	1
2,2-Dichloropropane	ND		ug/kg	3.7	0.37	1
1,2-Dibromoethane	ND		ug/kg	1.8	0.52	1
1,3-Dichloropropane	ND		ug/kg	3.7	0.31	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.93	0.24	1
Bromobenzene	ND		ug/kg	3.7	0.27	1
n-Butylbenzene	ND		ug/kg	1.8	0.31	1
sec-Butylbenzene	ND		ug/kg	1.8	0.27	1
tert-Butylbenzene	ND		ug/kg	3.7	0.22	1
o-Chlorotoluene	ND		ug/kg	3.7	0.35	1
p-Chlorotoluene	ND		ug/kg	3.7	0.20	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	5.6	1.8	1
Hexachlorobutadiene	ND		ug/kg	7.4	0.31	1
Isopropylbenzene	ND		ug/kg	1.8	0.20	1
p-Isopropyltoluene	ND		ug/kg	1.8	0.20	1
Naphthalene	ND		ug/kg	7.4	1.2	1
Acrylonitrile	ND		ug/kg	7.4	2.1	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-08 Date Collected: 10/15/25 14:15

Client ID: P6SB07_2-3 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.8	0.32	1
1,2,3-Trichlorobenzene	ND		ug/kg	3.7	0.60	1
1,2,4-Trichlorobenzene	ND		ug/kg	3.7	0.50	1
1,3,5-Trimethylbenzene	ND		ug/kg	3.7	0.36	1
1,2,4-Trimethylbenzene	ND		ug/kg	3.7	0.62	1
1,4-Dioxane	ND		ug/kg	150	65.	1
p-Diethylbenzene	ND		ug/kg	3.7	0.33	1
p-Ethyltoluene	ND		ug/kg	3.7	0.71	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	3.7	0.35	1
Ethyl ether	ND		ug/kg	3.7	0.63	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	9.3	2.6	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	128		70-130
Toluene-d8	95		70-130
4-Bromofluorobenzene	89		70-130
Dibromofluoromethane	126		70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-09 Date Collected: 10/15/25 14:30
Client ID: P6SB06_0-1 Date Received: 10/15/25
Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/25/25 19:39
Analyst: AJK
Percent Solids: 82%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	8.4	3.8	1
1,1-Dichloroethane	ND		ug/kg	1.7	0.24	1
Chloroform	ND		ug/kg	2.5	0.23	1
Carbon tetrachloride	ND		ug/kg	1.7	0.39	1
1,2-Dichloropropane	ND		ug/kg	1.7	0.21	1
Dibromochloromethane	ND		ug/kg	1.7	0.23	1
1,1,2-Trichloroethane	ND		ug/kg	1.7	0.45	1
Tetrachloroethene	ND		ug/kg	0.84	0.33	1
Chlorobenzene	ND		ug/kg	0.84	0.21	1
Trichlorofluoromethane	ND		ug/kg	6.7	1.2	1
1,2-Dichloroethane	ND		ug/kg	1.7	0.43	1
1,1,1-Trichloroethane	ND		ug/kg	0.84	0.28	1
Bromodichloromethane	ND		ug/kg	0.84	0.18	1
trans-1,3-Dichloropropene	ND		ug/kg	1.7	0.46	1
cis-1,3-Dichloropropene	ND		ug/kg	0.84	0.26	1
1,3-Dichloropropene, Total	ND		ug/kg	0.84	0.26	1
1,1-Dichloropropene	ND		ug/kg	0.84	0.27	1
Bromoform	ND		ug/kg	6.7	0.41	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.84	0.28	1
Benzene	ND		ug/kg	0.84	0.28	1
Toluene	ND		ug/kg	1.7	0.91	1
Ethylbenzene	ND		ug/kg	1.7	0.24	1
Chloromethane	ND		ug/kg	6.7	1.6	1
Bromomethane	ND		ug/kg	3.4	0.98	1
Vinyl chloride	ND		ug/kg	1.7	0.56	1
Chloroethane	ND		ug/kg	3.4	0.76	1
1,1-Dichloroethene	ND		ug/kg	1.7	0.40	1
trans-1,2-Dichloroethene	ND		ug/kg	2.5	0.23	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-09 Date Collected: 10/15/25 14:30

Client ID: P6SB06_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.84	0.23	1
1,2-Dichlorobenzene	ND		ug/kg	3.4	0.24	1
1,3-Dichlorobenzene	ND		ug/kg	3.4	0.25	1
1,4-Dichlorobenzene	ND		ug/kg	3.4	0.29	1
Methyl tert butyl ether	ND		ug/kg	3.4	0.34	1
p/m-Xylene	ND		ug/kg	3.4	0.94	1
o-Xylene	ND		ug/kg	1.7	0.49	1
Xylenes, Total	ND		ug/kg	1.7	0.49	1
cis-1,2-Dichloroethene	ND		ug/kg	1.7	0.29	1
1,2-Dichloroethene, Total	ND		ug/kg	1.7	0.23	1
Dibromomethane	ND		ug/kg	3.4	0.40	1
Styrene	ND		ug/kg	1.7	0.33	1
Dichlorodifluoromethane	ND		ug/kg	17	1.5	1
Acetone	ND		ug/kg	17	8.1	1
Carbon disulfide	ND		ug/kg	17	7.6	1
2-Butanone	ND		ug/kg	17	3.7	1
Vinyl acetate	ND		ug/kg	17	3.6	1
4-Methyl-2-pentanone	ND		ug/kg	17	2.1	1
1,2,3-Trichloropropane	ND		ug/kg	3.4	0.21	1
2-Hexanone	ND		ug/kg	17	2.0	1
Bromochloromethane	ND		ug/kg	3.4	0.34	1
2,2-Dichloropropane	ND		ug/kg	3.4	0.34	1
1,2-Dibromoethane	ND		ug/kg	1.7	0.47	1
1,3-Dichloropropane	ND		ug/kg	3.4	0.28	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.84	0.22	1
Bromobenzene	ND		ug/kg	3.4	0.24	1
n-Butylbenzene	ND		ug/kg	1.7	0.28	1
sec-Butylbenzene	ND		ug/kg	1.7	0.24	1
tert-Butylbenzene	ND		ug/kg	3.4	0.20	1
o-Chlorotoluene	ND		ug/kg	3.4	0.32	1
p-Chlorotoluene	ND		ug/kg	3.4	0.18	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	5.0	1.7	1
Hexachlorobutadiene	ND		ug/kg	6.7	0.28	1
Isopropylbenzene	ND		ug/kg	1.7	0.18	1
p-Isopropyltoluene	ND		ug/kg	1.7	0.18	1
Naphthalene	ND		ug/kg	6.7	1.1	1
Acrylonitrile	ND		ug/kg	6.7	1.9	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-09 Date Collected: 10/15/25 14:30

Client ID: P6SB06_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.7	0.29	1
1,2,3-Trichlorobenzene	ND		ug/kg	3.4	0.54	1
1,2,4-Trichlorobenzene	ND		ug/kg	3.4	0.46	1
1,3,5-Trimethylbenzene	ND		ug/kg	3.4	0.32	1
1,2,4-Trimethylbenzene	ND		ug/kg	3.4	0.56	1
1,4-Dioxane	ND		ug/kg	130	59.	1
p-Diethylbenzene	ND		ug/kg	3.4	0.30	1
p-Ethyltoluene	ND		ug/kg	3.4	0.64	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	3.4	0.32	1
Ethyl ether	ND		ug/kg	3.4	0.57	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	8.4	2.4	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**134**	Q	70-130
Toluene-d8	97		70-130
4-Bromofluorobenzene	90		70-130
Dibromofluoromethane	**131**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-10 Date Collected: 10/15/25 14:50
Client ID: P6SB06_3-4 Date Received: 10/15/25
Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/25/25 20:06
Analyst: AJK
Percent Solids: 85%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	9.0	4.1	1
1,1-Dichloroethane	ND		ug/kg	1.8	0.26	1
Chloroform	ND		ug/kg	2.7	0.25	1
Carbon tetrachloride	ND		ug/kg	1.8	0.41	1
1,2-Dichloropropane	ND		ug/kg	1.8	0.22	1
Dibromochloromethane	ND		ug/kg	1.8	0.25	1
1,1,2-Trichloroethane	ND		ug/kg	1.8	0.48	1
Tetrachloroethene	ND		ug/kg	0.90	0.35	1
Chlorobenzene	ND		ug/kg	0.90	0.23	1
Trichlorofluoromethane	ND		ug/kg	7.2	1.2	1
1,2-Dichloroethane	ND		ug/kg	1.8	0.46	1
1,1,1-Trichloroethane	ND		ug/kg	0.90	0.30	1
Bromodichloromethane	ND		ug/kg	0.90	0.20	1
trans-1,3-Dichloropropene	ND		ug/kg	1.8	0.49	1
cis-1,3-Dichloropropene	ND		ug/kg	0.90	0.28	1
1,3-Dichloropropene, Total	ND		ug/kg	0.90	0.28	1
1,1-Dichloropropene	ND		ug/kg	0.90	0.28	1
Bromoform	ND		ug/kg	7.2	0.44	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.90	0.30	1
Benzene	ND		ug/kg	0.90	0.30	1
Toluene	ND		ug/kg	1.8	0.98	1
Ethylbenzene	ND		ug/kg	1.8	0.25	1
Chloromethane	ND		ug/kg	7.2	1.7	1
Bromomethane	ND		ug/kg	3.6	1.0	1
Vinyl chloride	ND		ug/kg	1.8	0.60	1
Chloroethane	ND		ug/kg	3.6	0.81	1
1,1-Dichloroethene	ND		ug/kg	1.8	0.43	1
trans-1,2-Dichloroethene	ND		ug/kg	2.7	0.25	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-10 Date Collected: 10/15/25 14:50

Client ID: P6SB06_3-4 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.90	0.25	1
1,2-Dichlorobenzene	ND		ug/kg	3.6	0.26	1
1,3-Dichlorobenzene	ND		ug/kg	3.6	0.27	1
1,4-Dichlorobenzene	ND		ug/kg	3.6	0.31	1
Methyl tert butyl ether	ND		ug/kg	3.6	0.36	1
p/m-Xylene	ND		ug/kg	3.6	1.0	1
o-Xylene	ND		ug/kg	1.8	0.52	1
Xylenes, Total	ND		ug/kg	1.8	0.52	1
cis-1,2-Dichloroethene	ND		ug/kg	1.8	0.31	1
1,2-Dichloroethene, Total	ND		ug/kg	1.8	0.25	1
Dibromomethane	ND		ug/kg	3.6	0.43	1
Styrene	ND		ug/kg	1.8	0.35	1
Dichlorodifluoromethane	ND		ug/kg	18	1.6	1
Acetone	ND		ug/kg	18	8.6	1
Carbon disulfide	ND		ug/kg	18	8.2	1
2-Butanone	ND		ug/kg	18	4.0	1
Vinyl acetate	ND		ug/kg	18	3.9	1
4-Methyl-2-pentanone	ND		ug/kg	18	2.3	1
1,2,3-Trichloropropane	ND		ug/kg	3.6	0.23	1
2-Hexanone	ND		ug/kg	18	2.1	1
Bromochloromethane	ND		ug/kg	3.6	0.37	1
2,2-Dichloropropane	ND		ug/kg	3.6	0.36	1
1,2-Dibromoethane	ND		ug/kg	1.8	0.50	1
1,3-Dichloropropane	ND		ug/kg	3.6	0.30	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.90	0.24	1
Bromobenzene	ND		ug/kg	3.6	0.26	1
n-Butylbenzene	ND		ug/kg	1.8	0.30	1
sec-Butylbenzene	ND		ug/kg	1.8	0.26	1
tert-Butylbenzene	ND		ug/kg	3.6	0.21	1
o-Chlorotoluene	ND		ug/kg	3.6	0.34	1
p-Chlorotoluene	ND		ug/kg	3.6	0.19	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	5.4	1.8	1
Hexachlorobutadiene	ND		ug/kg	7.2	0.30	1
Isopropylbenzene	ND		ug/kg	1.8	0.20	1
p-Isopropyltoluene	ND		ug/kg	1.8	0.20	1
Naphthalene	ND		ug/kg	7.2	1.2	1
Acrylonitrile	ND		ug/kg	7.2	2.1	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-10 Date Collected: 10/15/25 14:50

Client ID: P6SB06_3-4 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.8	0.31	1
1,2,3-Trichlorobenzene	ND		ug/kg	3.6	0.58	1
1,2,4-Trichlorobenzene	ND		ug/kg	3.6	0.49	1
1,3,5-Trimethylbenzene	ND		ug/kg	3.6	0.35	1
1,2,4-Trimethylbenzene	ND		ug/kg	3.6	0.60	1
1,4-Dioxane	ND		ug/kg	140	63.	1
p-Diethylbenzene	ND		ug/kg	3.6	0.32	1
p-Ethyltoluene	ND		ug/kg	3.6	0.69	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	3.6	0.34	1
Ethyl ether	ND		ug/kg	3.6	0.61	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	9.0	2.6	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**136**	Q	70-130
Toluene-d8	99		70-130
4-Bromofluorobenzene	91		70-130
Dibromofluoromethane	**135**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/25/25 11:54
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 01-06,09-10 Batch: WG2133217-5					
Methylene chloride	ND		ug/kg	5.0	2.3
1,1-Dichloroethane	ND		ug/kg	1.0	0.14
Chloroform	0.41	J	ug/kg	1.5	0.14
Carbon tetrachloride	ND		ug/kg	1.0	0.23
1,2-Dichloropropane	ND		ug/kg	1.0	0.12
Dibromochloromethane	ND		ug/kg	1.0	0.14
1,1,2-Trichloroethane	ND		ug/kg	1.0	0.27
Tetrachloroethene	ND		ug/kg	0.50	0.20
Chlorobenzene	ND		ug/kg	0.50	0.13
Trichlorofluoromethane	ND		ug/kg	4.0	0.70
1,2-Dichloroethane	ND		ug/kg	1.0	0.26
1,1,1-Trichloroethane	ND		ug/kg	0.50	0.17
Bromodichloromethane	ND		ug/kg	0.50	0.11
trans-1,3-Dichloropropene	ND		ug/kg	1.0	0.27
cis-1,3-Dichloropropene	ND		ug/kg	0.50	0.16
1,3-Dichloropropene, Total	ND		ug/kg	0.50	0.16
1,1-Dichloropropene	ND		ug/kg	0.50	0.16
Bromoform	ND		ug/kg	4.0	0.25
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.50	0.17
Benzene	ND		ug/kg	0.50	0.17
Toluene	ND		ug/kg	1.0	0.54
Ethylbenzene	ND		ug/kg	1.0	0.14
Chloromethane	ND		ug/kg	4.0	0.93

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/25/25 11:54
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 01-06,09-10 Batch: WG2133217-5					
Bromomethane	ND		ug/kg	2.0	0.58
Vinyl chloride	ND		ug/kg	1.0	0.34
Chloroethane	ND		ug/kg	2.0	0.45
1,1-Dichloroethene	ND		ug/kg	1.0	0.24
trans-1,2-Dichloroethene	ND		ug/kg	1.5	0.14
Trichloroethene	ND		ug/kg	0.50	0.14
1,2-Dichlorobenzene	ND		ug/kg	2.0	0.14
1,3-Dichlorobenzene	ND		ug/kg	2.0	0.15
1,4-Dichlorobenzene	ND		ug/kg	2.0	0.17
Methyl tert butyl ether	ND		ug/kg	2.0	0.20
p/m-Xylene	ND		ug/kg	2.0	0.56
o-Xylene	ND		ug/kg	1.0	0.29
Xylenes, Total	ND		ug/kg	1.0	0.29
cis-1,2-Dichloroethene	ND		ug/kg	1.0	0.18
1,2-Dichloroethene, Total	ND		ug/kg	1.0	0.14
Dibromomethane	ND		ug/kg	2.0	0.24
Styrene	ND		ug/kg	1.0	0.20
Dichlorodifluoromethane	ND		ug/kg	10	0.92
Acetone	ND		ug/kg	10	4.8
Carbon disulfide	ND		ug/kg	10	4.6
2-Butanone	ND		ug/kg	10	2.2
Vinyl acetate	ND		ug/kg	10	2.2
4-Methyl-2-pentanone	ND		ug/kg	10	1.3

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/25/25 11:54
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 01-06,09-10 Batch: WG2133217-5					
1,2,3-Trichloropropane	ND		ug/kg	2.0	0.13
2-Hexanone	ND		ug/kg	10	1.2
Bromochloromethane	ND		ug/kg	2.0	0.20
2,2-Dichloropropane	ND		ug/kg	2.0	0.20
1,2-Dibromoethane	ND		ug/kg	1.0	0.28
1,3-Dichloropropane	ND		ug/kg	2.0	0.17
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.50	0.13
Bromobenzene	ND		ug/kg	2.0	0.14
n-Butylbenzene	ND		ug/kg	1.0	0.17
sec-Butylbenzene	ND		ug/kg	1.0	0.15
tert-Butylbenzene	ND		ug/kg	2.0	0.12
o-Chlorotoluene	ND		ug/kg	2.0	0.19
p-Chlorotoluene	ND		ug/kg	2.0	0.11
1,2-Dibromo-3-chloropropane	ND		ug/kg	3.0	1.0
Hexachlorobutadiene	ND		ug/kg	4.0	0.17
Isopropylbenzene	ND		ug/kg	1.0	0.11
p-Isopropyltoluene	ND		ug/kg	1.0	0.11
Naphthalene	ND		ug/kg	4.0	0.65
Acrylonitrile	ND		ug/kg	4.0	1.2
n-Propylbenzene	ND		ug/kg	1.0	0.17
1,2,3-Trichlorobenzene	ND		ug/kg	2.0	0.32
1,2,4-Trichlorobenzene	ND		ug/kg	2.0	0.27
1,3,5-Trimethylbenzene	ND		ug/kg	2.0	0.19

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/25/25 11:54
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 01-06,09-10 Batch: WG2133217-5					
1,2,4-Trimethylbenzene	ND		ug/kg	2.0	0.33
1,4-Dioxane	ND		ug/kg	80	35.
p-Diethylbenzene	ND		ug/kg	2.0	0.18
p-Ethyltoluene	ND		ug/kg	2.0	0.38
1,2,4,5-Tetramethylbenzene	ND		ug/kg	2.0	0.19
Ethyl ether	ND		ug/kg	2.0	0.34
trans-1,4-Dichloro-2-butene	ND		ug/kg	5.0	1.4

Surrogate	%Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	120		70-130
Toluene-d8	98		70-130
4-Bromofluorobenzene	88		70-130
Dibromofluoromethane	115		70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/28/25 13:15
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 07-08 Batch: WG2134398-5					
Methylene chloride	ND		ug/kg	5.0	2.3
1,1-Dichloroethane	ND		ug/kg	1.0	0.14
Chloroform	2.8		ug/kg	1.5	0.14
Carbon tetrachloride	ND		ug/kg	1.0	0.23
1,2-Dichloropropane	ND		ug/kg	1.0	0.12
Dibromochloromethane	ND		ug/kg	1.0	0.14
1,1,2-Trichloroethane	ND		ug/kg	1.0	0.27
Tetrachloroethene	ND		ug/kg	0.50	0.20
Chlorobenzene	ND		ug/kg	0.50	0.13
Trichlorofluoromethane	ND		ug/kg	4.0	0.70
1,2-Dichloroethane	ND		ug/kg	1.0	0.26
1,1,1-Trichloroethane	ND		ug/kg	0.50	0.17
Bromodichloromethane	ND		ug/kg	0.50	0.11
trans-1,3-Dichloropropene	ND		ug/kg	1.0	0.27
cis-1,3-Dichloropropene	ND		ug/kg	0.50	0.16
1,3-Dichloropropene, Total	ND		ug/kg	0.50	0.16
1,1-Dichloropropene	ND		ug/kg	0.50	0.16
Bromoform	ND		ug/kg	4.0	0.25
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.50	0.17
Benzene	ND		ug/kg	0.50	0.17
Toluene	ND		ug/kg	1.0	0.54
Ethylbenzene	ND		ug/kg	1.0	0.14
Chloromethane	ND		ug/kg	4.0	0.93
Bromomethane	0.69	J	ug/kg	2.0	0.58

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/28/25 13:15
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 07-08 Batch: WG2134398-5					
Vinyl chloride	ND		ug/kg	1.0	0.34
Chloroethane	ND		ug/kg	2.0	0.45
1,1-Dichloroethene	ND		ug/kg	1.0	0.24
trans-1,2-Dichloroethene	ND		ug/kg	1.5	0.14
Trichloroethene	ND		ug/kg	0.50	0.14
1,2-Dichlorobenzene	ND		ug/kg	2.0	0.14
1,3-Dichlorobenzene	ND		ug/kg	2.0	0.15
1,4-Dichlorobenzene	ND		ug/kg	2.0	0.17
Methyl tert butyl ether	ND		ug/kg	2.0	0.20
p/m-Xylene	ND		ug/kg	2.0	0.56
o-Xylene	ND		ug/kg	1.0	0.29
Xylenes, Total	ND		ug/kg	1.0	0.29
cis-1,2-Dichloroethene	ND		ug/kg	1.0	0.18
1,2-Dichloroethene, Total	ND		ug/kg	1.0	0.14
Dibromomethane	ND		ug/kg	2.0	0.24
Styrene	ND		ug/kg	1.0	0.20
Dichlorodifluoromethane	ND		ug/kg	10	0.92
Acetone	ND		ug/kg	10	4.8
Carbon disulfide	ND		ug/kg	10	4.6
2-Butanone	ND		ug/kg	10	2.2
Vinyl acetate	ND		ug/kg	10	2.2
4-Methyl-2-pentanone	ND		ug/kg	10	1.3
1,2,3-Trichloropropane	ND		ug/kg	2.0	0.13
2-Hexanone	ND		ug/kg	10	1.2

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/28/25 13:15
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 07-08 Batch: WG2134398-5					
Bromochloromethane	ND		ug/kg	2.0	0.20
2,2-Dichloropropane	ND		ug/kg	2.0	0.20
1,2-Dibromoethane	ND		ug/kg	1.0	0.28
1,3-Dichloropropane	ND		ug/kg	2.0	0.17
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.50	0.13
Bromobenzene	ND		ug/kg	2.0	0.14
n-Butylbenzene	ND		ug/kg	1.0	0.17
sec-Butylbenzene	ND		ug/kg	1.0	0.15
tert-Butylbenzene	ND		ug/kg	2.0	0.12
o-Chlorotoluene	ND		ug/kg	2.0	0.19
p-Chlorotoluene	ND		ug/kg	2.0	0.11
1,2-Dibromo-3-chloropropane	ND		ug/kg	3.0	1.0
Hexachlorobutadiene	ND		ug/kg	4.0	0.17
Isopropylbenzene	ND		ug/kg	1.0	0.11
p-Isopropyltoluene	ND		ug/kg	1.0	0.11
Naphthalene	ND		ug/kg	4.0	0.65
Acrylonitrile	ND		ug/kg	4.0	1.2
n-Propylbenzene	ND		ug/kg	1.0	0.17
1,2,3-Trichlorobenzene	ND		ug/kg	2.0	0.32
1,2,4-Trichlorobenzene	ND		ug/kg	2.0	0.27
1,3,5-Trimethylbenzene	ND		ug/kg	2.0	0.19
1,2,4-Trimethylbenzene	ND		ug/kg	2.0	0.33
1,4-Dioxane	ND		ug/kg	80	35.
p-Diethylbenzene	ND		ug/kg	2.0	0.18

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/28/25 13:15
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 07-08 Batch: WG2134398-5					
p-Ethyltoluene	ND		ug/kg	2.0	0.38
1,2,4,5-Tetramethylbenzene	ND		ug/kg	2.0	0.19
Ethyl ether	ND		ug/kg	2.0	0.34
trans-1,4-Dichloro-2-butene	ND		ug/kg	5.0	1.4

Surrogate	%Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	116		70-130
Toluene-d8	97		70-130
4-Bromofluorobenzene	90		70-130
Dibromofluoromethane	119		70-130

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 01-06,09-10 Batch: WG2133217-3 WG2133217-4								
Methylene chloride	85		82		70-130	4		30
1,1-Dichloroethane	103		101		70-130	2		30
Chloroform	99		96		70-130	3		30
Carbon tetrachloride	122		119		70-130	2		30
1,2-Dichloropropane	98		97		70-130	1		30
Dibromochloromethane	114		115		70-130	1		30
1,1,2-Trichloroethane	111		110		70-130	1		30
Tetrachloroethene	**133**	Q	129		70-130	3		30
Chlorobenzene	108		108		70-130	0		30
Trichlorofluoromethane	96		93		70-139	3		30
1,2-Dichloroethane	107		105		70-130	2		30
1,1,1-Trichloroethane	115		113		70-130	2		30
Bromodichloromethane	106		102		70-130	4		30
trans-1,3-Dichloropropene	111		110		70-130	1		30
cis-1,3-Dichloropropene	105		104		70-130	1		30
1,1-Dichloropropene	105		100		70-130	5		30
Bromoform	111		113		70-130	2		30
1,1,2,2-Tetrachloroethane	102		98		70-130	4		30
Benzene	103		100		70-130	3		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 01-06,09-10 Batch: WG2133217-3 WG2133217-4								
Toluene	105		105		70-130	0		30
Ethylbenzene	107		106		70-130	1		30
Chloromethane	116		112		52-130	4		30
Bromomethane	60		60		57-147	0		30
Vinyl chloride	93		92		67-130	1		30
Chloroethane	76		75		50-151	1		30
1,1-Dichloroethene	81		78		65-135	4		30
trans-1,2-Dichloroethene	103		102		70-130	1		30
Trichloroethene	113		110		70-130	3		30
1,2-Dichlorobenzene	108		109		70-130	1		30
1,3-Dichlorobenzene	112		111		70-130	1		30
1,4-Dichlorobenzene	109		108		70-130	1		30
Methyl tert butyl ether	90		89		66-130	1		30
p/m-Xylene	108		106		70-130	2		30
o-Xylene	104		103		70-130	1		30
cis-1,2-Dichloroethene	99		97		70-130	2		30
Dibromomethane	99		98		70-130	1		30
Styrene	108		107		70-130	1		30
Dichlorodifluoromethane	128		124		30-146	3		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 01-06,09-10 Batch: WG2133217-3 WG2133217-4								
Acetone	95		91		54-140	4		30
Carbon disulfide	77		74		59-130	4		30
2-Butanone	114		111		70-130	3		30
Vinyl acetate	113		105		70-130	7		30
4-Methyl-2-pentanone	93		90		70-130	3		30
1,2,3-Trichloropropane	102		101		68-130	1		30
2-Hexanone	87		88		70-130	1		30
Bromochloromethane	105		105		70-130	0		30
2,2-Dichloropropane	104		101		70-130	3		30
1,2-Dibromoethane	110		110		70-130	0		30
1,3-Dichloropropane	104		105		69-130	1		30
1,1,1,2-Tetrachloroethane	121		118		70-130	3		30
Bromobenzene	108		104		70-130	4		30
n-Butylbenzene	113		112		70-130	1		30
sec-Butylbenzene	110		109		70-130	1		30
tert-Butylbenzene	105		104		70-130	1		30
o-Chlorotoluene	105		103		70-130	2		30
p-Chlorotoluene	104		102		70-130	2		30
1,2-Dibromo-3-chloropropane	96		97		68-130	1		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 01-06,09-10 Batch: WG2133217-3 WG2133217-4								
Hexachlorobutadiene	**131**	Q	128		67-130	2		30
Isopropylbenzene	99		100		70-130	1		30
p-Isopropyltoluene	108		106		70-130	2		30
Naphthalene	94		92		70-130	2		30
Acrylonitrile	99		98		70-130	1		30
n-Propylbenzene	110		106		70-130	4		30
1,2,3-Trichlorobenzene	112		107		70-130	5		30
1,2,4-Trichlorobenzene	110		108		70-130	2		30
1,3,5-Trimethylbenzene	107		106		70-130	1		30
1,2,4-Trimethylbenzene	105		104		70-130	1		30
1,4-Dioxane	88		86		65-136	2		30
p-Diethylbenzene	104		103		70-130	1		30
p-Ethyltoluene	105		103		70-130	2		30
1,2,4,5-Tetramethylbenzene	100		95		70-130	5		30
Ethyl ether	73		73		67-130	0		30
trans-1,4-Dichloro-2-butene	105		102		70-130	3		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 01-06,09-10 Batch: WG2133217-3 WG2133217-4								

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria
1,2-Dichloroethane-d4	109		104		70-130
Toluene-d8	102		102		70-130
4-Bromofluorobenzene	99		88		70-130
Dibromofluoromethane	103		103		70-130

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 07-08 Batch: WG2134398-3 WG2134398-4								
Methylene chloride	82		84		70-130	2		30
1,1-Dichloroethane	92		97		70-130	5		30
Chloroform	89		95		70-130	7		30
Carbon tetrachloride	112		122		70-130	9		30
1,2-Dichloropropane	85		88		70-130	3		30
Dibromochloromethane	100		104		70-130	4		30
1,1,2-Trichloroethane	92		96		70-130	4		30
Tetrachloroethene	119		126		70-130	6		30
Chlorobenzene	96		101		70-130	5		30
Trichlorofluoromethane	85		90		70-139	6		30
1,2-Dichloroethane	90		94		70-130	4		30
1,1,1-Trichloroethane	102		113		70-130	10		30
Bromodichloromethane	90		92		70-130	2		30
trans-1,3-Dichloropropene	92		97		70-130	5		30
cis-1,3-Dichloropropene	84		87		70-130	4		30
1,1-Dichloropropene	94		101		70-130	7		30
Bromoform	96		106		70-130	10		30
1,1,2,2-Tetrachloroethane	85		91		70-130	7		30
Benzene	91		96		70-130	5		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 07-08 Batch: WG2134398-3 WG2134398-4								
Toluene	93		97		70-130	4		30
Ethylbenzene	94		99		70-130	5		30
Chloromethane	89		95		52-130	7		30
Bromomethane	**52**	Q	**56**	Q	57-147	7		30
Vinyl chloride	77		83		67-130	8		30
Chloroethane	64		69		50-151	8		30
1,1-Dichloroethene	73		77		65-135	5		30
trans-1,2-Dichloroethene	93		101		70-130	8		30
Trichloroethene	100		105		70-130	5		30
1,2-Dichlorobenzene	92		100		70-130	8		30
1,3-Dichlorobenzene	98		103		70-130	5		30
1,4-Dichlorobenzene	96		100		70-130	4		30
Methyl tert butyl ether	76		80		66-130	5		30
p/m-Xylene	96		101		70-130	5		30
o-Xylene	91		97		70-130	6		30
cis-1,2-Dichloroethene	87		94		70-130	8		30
Dibromomethane	85		91		70-130	7		30
Styrene	93		97		70-130	4		30
Dichlorodifluoromethane	86		92		30-146	7		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 07-08 Batch: WG2134398-3 WG2134398-4								
Acetone	95		98		54-140	3		30
Carbon disulfide	68		72		59-130	6		30
2-Butanone	103		113		70-130	9		30
Vinyl acetate	88		94		70-130	7		30
4-Methyl-2-pentanone	79		85		70-130	7		30
1,2,3-Trichloropropane	87		94		68-130	8		30
2-Hexanone	74		83		70-130	11		30
Bromochloromethane	93		98		70-130	5		30
2,2-Dichloropropane	91		98		70-130	7		30
1,2-Dibromoethane	94		100		70-130	6		30
1,3-Dichloropropane	89		93		69-130	4		30
1,1,1,2-Tetrachloroethane	103		109		70-130	6		30
Bromobenzene	93		98		70-130	5		30
n-Butylbenzene	97		107		70-130	10		30
sec-Butylbenzene	98		107		70-130	9		30
tert-Butylbenzene	94		102		70-130	8		30
o-Chlorotoluene	91		99		70-130	8		30
p-Chlorotoluene	89		95		70-130	7		30
1,2-Dibromo-3-chloropropane	86		100		68-130	15		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 07-08 Batch: WG2134398-3 WG2134398-4								
Hexachlorobutadiene	118		129		67-130	9		30
Isopropylbenzene	89		98		70-130	10		30
p-Isopropyltoluene	96		102		70-130	6		30
Naphthalene	78		85		70-130	9		30
Acrylonitrile	91		100		70-130	9		30
n-Propylbenzene	95		102		70-130	7		30
1,2,3-Trichlorobenzene	90		96		70-130	6		30
1,2,4-Trichlorobenzene	90		95		70-130	5		30
1,3,5-Trimethylbenzene	93		100		70-130	7		30
1,2,4-Trimethylbenzene	91		98		70-130	7		30
1,4-Dioxane	84		92		65-136	9		30
p-Diethylbenzene	92		98		70-130	6		30
p-Ethyltoluene	92		99		70-130	7		30
1,2,4,5-Tetramethylbenzene	81		86		70-130	6		30
Ethyl ether	**61**	Q	**65**	Q	67-130	6		30
trans-1,4-Dichloro-2-butene	86		94		70-130	9		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 07-08 Batch: WG2134398-3 WG2134398-4								

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria
1,2-Dichloroethane-d4	102		99		70-130
Toluene-d8	100		99		70-130
4-Bromofluorobenzene	89		89		70-130
Dibromofluoromethane	102		102		70-130

SEMIVOLATILES

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-01
Client ID: P6SB03_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 09:40
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/18/25 00:37
Analyst: IMK
Percent Solids: 85%

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	ND		ug/kg	150	20.	1
1,2,4-Trichlorobenzene	ND		ug/kg	190	22.	1
Hexachlorobenzene	ND		ug/kg	110	21.	1
Bis(2-chloroethyl)ether	ND		ug/kg	170	26.	1
2-Chloronaphthalene	ND		ug/kg	190	19.	1
1,2-Dichlorobenzene	ND		ug/kg	190	34.	1
1,3-Dichlorobenzene	ND		ug/kg	190	33.	1
1,4-Dichlorobenzene	ND		ug/kg	190	33.	1
3,3'-Dichlorobenzidine	ND		ug/kg	190	51.	1
2,4-Dinitrotoluene	ND		ug/kg	190	38.	1
2,6-Dinitrotoluene	ND		ug/kg	190	33.	1
Fluoranthene	440		ug/kg	110	22.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	190	20.	1
4-Bromophenyl phenyl ether	ND		ug/kg	190	29.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	230	33.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	210	19.	1
Hexachlorobutadiene	ND		ug/kg	190	28.	1
Hexachlorocyclopentadiene	ND		ug/kg	550	170	1
Hexachloroethane	ND		ug/kg	150	31.	1
Isophorone	ND		ug/kg	170	25.	1
Naphthalene	24	J	ug/kg	190	23.	1
Nitrobenzene	ND		ug/kg	170	28.	1
NDPA/DPA	ND		ug/kg	150	22.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	190	30.	1
Bis(2-ethylhexyl)phthalate	170	J	ug/kg	190	66.	1
Butyl benzyl phthalate	ND		ug/kg	190	48.	1
Di-n-butylphthalate	ND		ug/kg	190	36.	1
Di-n-octylphthalate	ND		ug/kg	190	65.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-01 Date Collected: 10/15/25 09:40

Client ID: P6SB03_1-2 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	190	18.	1
Dimethyl phthalate	ND		ug/kg	190	40.	1
Benzo(a)anthracene	230		ug/kg	110	22.	1
Benzo(a)pyrene	230		ug/kg	150	47.	1
Benzo(b)fluoranthene	310		ug/kg	110	32.	1
Benzo(k)fluoranthene	110		ug/kg	110	30.	1
Chrysene	230		ug/kg	110	20.	1
Acenaphthylene	ND		ug/kg	150	30.	1
Anthracene	60	J	ug/kg	110	37.	1
Benzo(ghi)perylene	150		ug/kg	150	22.	1
Fluorene	18	J	ug/kg	190	18.	1
Phenanthrene	230		ug/kg	110	23.	1
Dibenzo(a,h)anthracene	43	J	ug/kg	110	22.	1
Indeno(1,2,3-cd)pyrene	130	J	ug/kg	150	27.	1
Pyrene	370		ug/kg	110	19.	1
Biphenyl	ND		ug/kg	440	25.	1
4-Chloroaniline	ND		ug/kg	190	35.	1
2-Nitroaniline	ND		ug/kg	190	37.	1
3-Nitroaniline	ND		ug/kg	190	36.	1
4-Nitroaniline	ND		ug/kg	190	79.	1
Dibenzofuran	ND		ug/kg	190	18.	1
2-Methylnaphthalene	ND		ug/kg	230	23.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	190	20.	1
Acetophenone	ND		ug/kg	190	24.	1
2,4,6-Trichlorophenol	ND		ug/kg	110	36.	1
p-Chloro-m-cresol	ND		ug/kg	190	28.	1
2-Chlorophenol	ND		ug/kg	190	23.	1
2,4-Dichlorophenol	ND		ug/kg	170	31.	1
2,4-Dimethylphenol	ND		ug/kg	190	63.	1
2-Nitrophenol	ND		ug/kg	410	72.	1
4-Nitrophenol	ND		ug/kg	270	78.	1
2,4-Dinitrophenol	ND		ug/kg	920	89.	1
4,6-Dinitro-o-cresol	ND		ug/kg	500	92.	1
Pentachlorophenol	ND		ug/kg	150	42.	1
Phenol	ND		ug/kg	190	29.	1
2-Methylphenol	ND		ug/kg	190	30.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	280	30.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-01 Date Collected: 10/15/25 09:40

Client ID: P6SB03_1-2 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	190	37.	1
Benzoic Acid	ND		ug/kg	620	190	1
Benzyl Alcohol	ND		ug/kg	190	58.	1
Carbazole	27	J	ug/kg	190	18.	1
1,4-Dioxane	ND		ug/kg	29	8.8	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	51		25-120
Phenol-d6	54		10-120
Nitrobenzene-d5	55		23-120
2-Fluorobiphenyl	64		30-120
2,4,6-Tribromophenol	92		10-136
4-Terphenyl-d14	75		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-02
Client ID: P6SB03_4-5
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 10:00
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/17/25 20:42
Analyst: IMK
Percent Solids: 88%

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	19	J	ug/kg	150	19.	1
1,2,4-Trichlorobenzene	ND		ug/kg	180	21.	1
Hexachlorobenzene	ND		ug/kg	110	21.	1
Bis(2-chloroethyl)ether	ND		ug/kg	170	25.	1
2-Chloronaphthalene	ND		ug/kg	180	18.	1
1,2-Dichlorobenzene	ND		ug/kg	180	33.	1
1,3-Dichlorobenzene	ND		ug/kg	180	32.	1
1,4-Dichlorobenzene	ND		ug/kg	180	32.	1
3,3'-Dichlorobenzidine	ND		ug/kg	180	49.	1
2,4-Dinitrotoluene	ND		ug/kg	180	37.	1
2,6-Dinitrotoluene	ND		ug/kg	180	32.	1
Fluoranthene	ND		ug/kg	110	21.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	180	20.	1
4-Bromophenyl phenyl ether	ND		ug/kg	180	28.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	220	32.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	200	18.	1
Hexachlorobutadiene	ND		ug/kg	180	27.	1
Hexachlorocyclopentadiene	ND		ug/kg	530	170	1
Hexachloroethane	ND		ug/kg	150	30.	1
Isophorone	ND		ug/kg	170	24.	1
Naphthalene	120	J	ug/kg	180	22.	1
Nitrobenzene	ND		ug/kg	170	27.	1
NDPA/DPA	ND		ug/kg	150	21.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	180	28.	1
Bis(2-ethylhexyl)phthalate	ND		ug/kg	180	64.	1
Butyl benzyl phthalate	ND		ug/kg	180	46.	1
Di-n-butylphthalate	ND		ug/kg	180	35.	1
Di-n-octylphthalate	ND		ug/kg	180	63.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-02 Date Collected: 10/15/25 10:00

Client ID: P6SB03_4-5 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	180	17.	1
Dimethyl phthalate	ND		ug/kg	180	39.	1
Benzo(a)anthracene	ND		ug/kg	110	21.	1
Benzo(a)pyrene	ND		ug/kg	150	45.	1
Benzo(b)fluoranthene	ND		ug/kg	110	31.	1
Benzo(k)fluoranthene	ND		ug/kg	110	30.	1
Chrysene	ND		ug/kg	110	19.	1
Acenaphthylene	ND		ug/kg	150	28.	1
Anthracene	ND		ug/kg	110	36.	1
Benzo(ghi)perylene	ND		ug/kg	150	22.	1
Fluorene	ND		ug/kg	180	18.	1
Phenanthrene	ND		ug/kg	110	22.	1
Dibenzo(a,h)anthracene	ND		ug/kg	110	21.	1
Indeno(1,2,3-cd)pyrene	ND		ug/kg	150	26.	1
Pyrene	ND		ug/kg	110	18.	1
Biphenyl	ND		ug/kg	420	24.	1
4-Chloroaniline	ND		ug/kg	180	34.	1
2-Nitroaniline	ND		ug/kg	180	36.	1
3-Nitroaniline	ND		ug/kg	180	35.	1
4-Nitroaniline	ND		ug/kg	180	76.	1
Dibenzofuran	ND		ug/kg	180	17.	1
2-Methylnaphthalene	91	J	ug/kg	220	22.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	180	19.	1
Acetophenone	ND		ug/kg	180	23.	1
2,4,6-Trichlorophenol	ND		ug/kg	110	35.	1
p-Chloro-m-cresol	ND		ug/kg	180	28.	1
2-Chlorophenol	ND		ug/kg	180	22.	1
2,4-Dichlorophenol	ND		ug/kg	170	30.	1
2,4-Dimethylphenol	ND		ug/kg	180	61.	1
2-Nitrophenol	ND		ug/kg	400	70.	1
4-Nitrophenol	ND		ug/kg	260	75.	1
2,4-Dinitrophenol	ND		ug/kg	890	86.	1
4,6-Dinitro-o-cresol	ND		ug/kg	480	89.	1
Pentachlorophenol	ND		ug/kg	150	41.	1
Phenol	ND		ug/kg	180	28.	1
2-Methylphenol	ND		ug/kg	180	29.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	270	29.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-02 Date Collected: 10/15/25 10:00

Client ID: P6SB03_4-5 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	180	35.	1
Benzoic Acid	ND		ug/kg	600	190	1
Benzyl Alcohol	ND		ug/kg	180	56.	1
Carbazole	ND		ug/kg	180	18.	1
1,4-Dioxane	ND		ug/kg	28	8.5	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	69		25-120
Phenol-d6	66		10-120
Nitrobenzene-d5	62		23-120
2-Fluorobiphenyl	67		30-120
2,4,6-Tribromophenol	76		10-136
4-Terphenyl-d14	65		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-03
Client ID: P6SB04_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 11:00
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/18/25 01:13
Analyst: IMK
Percent Solids: 83%

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	38	J	ug/kg	160	21.	1
1,2,4-Trichlorobenzene	ND		ug/kg	200	23.	1
Hexachlorobenzene	ND		ug/kg	120	22.	1
Bis(2-chloroethyl)ether	ND		ug/kg	180	27.	1
2-Chloronaphthalene	ND		ug/kg	200	20.	1
1,2-Dichlorobenzene	ND		ug/kg	200	36.	1
1,3-Dichlorobenzene	ND		ug/kg	200	34.	1
1,4-Dichlorobenzene	ND		ug/kg	200	35.	1
3,3'-Dichlorobenzidine	ND		ug/kg	200	53.	1
2,4-Dinitrotoluene	ND		ug/kg	200	40.	1
2,6-Dinitrotoluene	ND		ug/kg	200	34.	1
Fluoranthene	1500		ug/kg	120	23.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	200	21.	1
4-Bromophenyl phenyl ether	ND		ug/kg	200	30.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	240	34.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	220	20.	1
Hexachlorobutadiene	ND		ug/kg	200	29.	1
Hexachlorocyclopentadiene	ND		ug/kg	570	180	1
Hexachloroethane	ND		ug/kg	160	32.	1
Isophorone	ND		ug/kg	180	26.	1
Naphthalene	53	J	ug/kg	200	24.	1
Nitrobenzene	ND		ug/kg	180	30.	1
NDPA/DPA	ND		ug/kg	160	23.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	200	31.	1
Bis(2-ethylhexyl)phthalate	180	J	ug/kg	200	69.	1
Butyl benzyl phthalate	ND		ug/kg	200	50.	1
Di-n-butylphthalate	ND		ug/kg	200	38.	1
Di-n-octylphthalate	ND		ug/kg	200	68.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-03 Date Collected: 10/15/25 11:00

Client ID: P6SB04_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	200	18.	1
Dimethyl phthalate	ND		ug/kg	200	42.	1
Benzo(a)anthracene	660		ug/kg	120	22.	1
Benzo(a)pyrene	690		ug/kg	160	49.	1
Benzo(b)fluoranthene	880		ug/kg	120	34.	1
Benzo(k)fluoranthene	280		ug/kg	120	32.	1
Chrysene	680		ug/kg	120	21.	1
Acenaphthylene	56	J	ug/kg	160	31.	1
Anthracene	140		ug/kg	120	39.	1
Benzo(ghi)perylene	450		ug/kg	160	24.	1
Fluorene	49	J	ug/kg	200	19.	1
Phenanthrene	710		ug/kg	120	24.	1
Dibenzo(a,h)anthracene	110	J	ug/kg	120	23.	1
Indeno(1,2,3-cd)pyrene	380		ug/kg	160	28.	1
Pyrene	1200		ug/kg	120	20.	1
Biphenyl	ND		ug/kg	460	26.	1
4-Chloroaniline	ND		ug/kg	200	36.	1
2-Nitroaniline	ND		ug/kg	200	38.	1
3-Nitroaniline	ND		ug/kg	200	38.	1
4-Nitroaniline	ND		ug/kg	200	83.	1
Dibenzofuran	39	J	ug/kg	200	19.	1
2-Methylnaphthalene	42	J	ug/kg	240	24.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	200	21.	1
Acetophenone	ND		ug/kg	200	25.	1
2,4,6-Trichlorophenol	ND		ug/kg	120	38.	1
p-Chloro-m-cresol	ND		ug/kg	200	30.	1
2-Chlorophenol	ND		ug/kg	200	24.	1
2,4-Dichlorophenol	ND		ug/kg	180	32.	1
2,4-Dimethylphenol	ND		ug/kg	200	66.	1
2-Nitrophenol	ND		ug/kg	430	75.	1
4-Nitrophenol	ND		ug/kg	280	82.	1
2,4-Dinitrophenol	ND		ug/kg	960	93.	1
4,6-Dinitro-o-cresol	ND		ug/kg	520	96.	1
Pentachlorophenol	ND		ug/kg	160	44.	1
Phenol	ND		ug/kg	200	30.	1
2-Methylphenol	ND		ug/kg	200	31.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	290	31.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-03 Date Collected: 10/15/25 11:00

Client ID: P6SB04_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	200	38.	1
Benzoic Acid	ND		ug/kg	650	200	1
Benzyl Alcohol	ND		ug/kg	200	61.	1
Carbazole	83	J	ug/kg	200	19.	1
1,4-Dioxane	ND		ug/kg	30	9.2	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	52		25-120
Phenol-d6	51		10-120
Nitrobenzene-d5	50		23-120
2-Fluorobiphenyl	56		30-120
2,4,6-Tribromophenol	74		10-136
4-Terphenyl-d14	58		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-04
Client ID: P6SB04_4-5
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 11:40
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/21/25 17:30
Analyst: JG
Percent Solids: 76%

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	ND		ug/kg	170	22.	1
1,2,4-Trichlorobenzene	ND		ug/kg	220	25.	1
Hexachlorobenzene	ND		ug/kg	130	24.	1
Bis(2-chloroethyl)ether	ND		ug/kg	190	29.	1
2-Chloronaphthalene	ND		ug/kg	220	21.	1
1,2-Dichlorobenzene	ND		ug/kg	220	39.	1
1,3-Dichlorobenzene	ND		ug/kg	220	37.	1
1,4-Dichlorobenzene	ND		ug/kg	220	38.	1
3,3'-Dichlorobenzidine	ND		ug/kg	220	57.	1
2,4-Dinitrotoluene	ND		ug/kg	220	43.	1
2,6-Dinitrotoluene	ND		ug/kg	220	37.	1
Fluoranthene	420		ug/kg	130	25.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	220	23.	1
4-Bromophenyl phenyl ether	ND		ug/kg	220	33.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	260	37.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	230	22.	1
Hexachlorobutadiene	ND		ug/kg	220	32.	1
Hexachlorocyclopentadiene	ND		ug/kg	620	200	1
Hexachloroethane	ND		ug/kg	170	35.	1
Isophorone	ND		ug/kg	190	28.	1
Naphthalene	34	J	ug/kg	220	26.	1
Nitrobenzene	ND		ug/kg	190	32.	1
NDPA/DPA	ND		ug/kg	170	24.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	220	33.	1
Bis(2-ethylhexyl)phthalate	ND		ug/kg	220	75.	1
Butyl benzyl phthalate	ND		ug/kg	220	54.	1
Di-n-butylphthalate	ND		ug/kg	220	41.	1
Di-n-octylphthalate	ND		ug/kg	220	73.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-04 Date Collected: 10/15/25 11:40

Client ID: P6SB04_4-5 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	220	20.	1
Dimethyl phthalate	ND		ug/kg	220	45.	1
Benzo(a)anthracene	240		ug/kg	130	24.	1
Benzo(a)pyrene	300		ug/kg	170	53.	1
Benzo(b)fluoranthene	380		ug/kg	130	36.	1
Benzo(k)fluoranthene	94	J	ug/kg	130	34.	1
Chrysene	250		ug/kg	130	22.	1
Acenaphthylene	ND		ug/kg	170	33.	1
Anthracene	50	J	ug/kg	130	42.	1
Benzo(ghi)perylene	160	J	ug/kg	170	25.	1
Fluorene	ND		ug/kg	220	21.	1
Phenanthrene	220		ug/kg	130	26.	1
Dibenzo(a,h)anthracene	42	J	ug/kg	130	25.	1
Indeno(1,2,3-cd)pyrene	150	J	ug/kg	170	30.	1
Pyrene	380		ug/kg	130	21.	1
Biphenyl	ND		ug/kg	490	28.	1
4-Chloroaniline	ND		ug/kg	220	39.	1
2-Nitroaniline	ND		ug/kg	220	42.	1
3-Nitroaniline	ND		ug/kg	220	41.	1
4-Nitroaniline	ND		ug/kg	220	89.	1
Dibenzofuran	ND		ug/kg	220	20.	1
2-Methylnaphthalene	ND		ug/kg	260	26.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	220	22.	1
Acetophenone	ND		ug/kg	220	27.	1
2,4,6-Trichlorophenol	ND		ug/kg	130	41.	1
p-Chloro-m-cresol	ND		ug/kg	220	32.	1
2-Chlorophenol	ND		ug/kg	220	25.	1
2,4-Dichlorophenol	ND		ug/kg	190	35.	1
2,4-Dimethylphenol	ND		ug/kg	220	71.	1
2-Nitrophenol	ND		ug/kg	460	81.	1
4-Nitrophenol	ND		ug/kg	300	88.	1
2,4-Dinitrophenol	ND		ug/kg	1000	100	1
4,6-Dinitro-o-cresol	ND		ug/kg	560	100	1
Pentachlorophenol	ND		ug/kg	170	47.	1
Phenol	ND		ug/kg	220	32.	1
2-Methylphenol	ND		ug/kg	220	33.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	310	34.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-04 Date Collected: 10/15/25 11:40

Client ID: P6SB04_4-5 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	220	41.	1
Benzoic Acid	ND		ug/kg	700	220	1
Benzyl Alcohol	ND		ug/kg	220	66.	1
Carbazole	27	J	ug/kg	220	21.	1
1,4-Dioxane	ND		ug/kg	32	9.9	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	47		25-120
Phenol-d6	51		10-120
Nitrobenzene-d5	51		23-120
2-Fluorobiphenyl	62		30-120
2,4,6-Tribromophenol	79		10-136
4-Terphenyl-d14	67		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-05
Client ID: P6SB10_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 12:20
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/18/25 02:43
Analyst: IMK
Percent Solids: 89%

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	20	J	ug/kg	150	19.	1
1,2,4-Trichlorobenzene	ND		ug/kg	180	21.	1
Hexachlorobenzene	ND		ug/kg	110	20.	1
Bis(2-chloroethyl)ether	ND		ug/kg	160	25.	1
2-Chloronaphthalene	ND		ug/kg	180	18.	1
1,2-Dichlorobenzene	ND		ug/kg	180	33.	1
1,3-Dichlorobenzene	ND		ug/kg	180	31.	1
1,4-Dichlorobenzene	ND		ug/kg	180	32.	1
3,3'-Dichlorobenzidine	ND		ug/kg	180	49.	1
2,4-Dinitrotoluene	ND		ug/kg	180	36.	1
2,6-Dinitrotoluene	ND		ug/kg	180	31.	1
Fluoranthene	790		ug/kg	110	21.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	180	20.	1
4-Bromophenyl phenyl ether	ND		ug/kg	180	28.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	220	31.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	200	18.	1
Hexachlorobutadiene	ND		ug/kg	180	27.	1
Hexachlorocyclopentadiene	ND		ug/kg	520	160	1
Hexachloroethane	ND		ug/kg	150	30.	1
Isophorone	ND		ug/kg	160	24.	1
Naphthalene	70	J	ug/kg	180	22.	1
Nitrobenzene	ND		ug/kg	160	27.	1
NDPA/DPA	ND		ug/kg	150	21.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	180	28.	1
Bis(2-ethylhexyl)phthalate	340		ug/kg	180	63.	1
Butyl benzyl phthalate	ND		ug/kg	180	46.	1
Di-n-butylphthalate	ND		ug/kg	180	35.	1
Di-n-octylphthalate	ND		ug/kg	180	62.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-05 Date Collected: 10/15/25 12:20

Client ID: P6SB10_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	180	17.	1
Dimethyl phthalate	ND		ug/kg	180	38.	1
Benzo(a)anthracene	540		ug/kg	110	20.	1
Benzo(a)pyrene	540		ug/kg	150	45.	1
Benzo(b)fluoranthene	760		ug/kg	110	31.	1
Benzo(k)fluoranthene	220		ug/kg	110	29.	1
Chrysene	540		ug/kg	110	19.	1
Acenaphthylene	82	J	ug/kg	150	28.	1
Anthracene	100	J	ug/kg	110	36.	1
Benzo(ghi)perylene	350		ug/kg	150	22.	1
Fluorene	28	J	ug/kg	180	18.	1
Phenanthrene	430		ug/kg	110	22.	1
Dibenzo(a,h)anthracene	96	J	ug/kg	110	21.	1
Indeno(1,2,3-cd)pyrene	300		ug/kg	150	26.	1
Pyrene	640		ug/kg	110	18.	1
Biphenyl	ND		ug/kg	420	24.	1
4-Chloroaniline	ND		ug/kg	180	33.	1
2-Nitroaniline	ND		ug/kg	180	35.	1
3-Nitroaniline	ND		ug/kg	180	34.	1
4-Nitroaniline	ND		ug/kg	180	76.	1
Dibenzofuran	37	J	ug/kg	180	17.	1
2-Methylnaphthalene	73	J	ug/kg	220	22.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	180	19.	1
Acetophenone	ND		ug/kg	180	23.	1
2,4,6-Trichlorophenol	ND		ug/kg	110	35.	1
p-Chloro-m-cresol	ND		ug/kg	180	27.	1
2-Chlorophenol	ND		ug/kg	180	22.	1
2,4-Dichlorophenol	ND		ug/kg	160	29.	1
2,4-Dimethylphenol	ND		ug/kg	180	60.	1
2-Nitrophenol	ND		ug/kg	400	69.	1
4-Nitrophenol	ND		ug/kg	260	75.	1
2,4-Dinitrophenol	ND		ug/kg	880	85.	1
4,6-Dinitro-o-cresol	ND		ug/kg	480	88.	1
Pentachlorophenol	ND		ug/kg	150	40.	1
Phenol	ND		ug/kg	180	28.	1
2-Methylphenol	ND		ug/kg	180	28.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	260	29.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-05 Date Collected: 10/15/25 12:20

Client ID: P6SB10_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	180	35.	1
Benzoic Acid	ND		ug/kg	590	180	1
Benzyl Alcohol	ND		ug/kg	180	56.	1
Carbazole	41	J	ug/kg	180	18.	1
1,4-Dioxane	ND		ug/kg	27	8.4	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	63		25-120
Phenol-d6	67		10-120
Nitrobenzene-d5	68		23-120
2-Fluorobiphenyl	73		30-120
2,4,6-Tribromophenol	91		10-136
4-Terphenyl-d14	67		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-06
Client ID: P6SB10_2-3
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 12:45
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/17/25 21:55
Analyst: IMK
Percent Solids: 87%

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	ND		ug/kg	150	19.	1
1,2,4-Trichlorobenzene	ND		ug/kg	190	21.	1
Hexachlorobenzene	ND		ug/kg	110	21.	1
Bis(2-chloroethyl)ether	ND		ug/kg	170	25.	1
2-Chloronaphthalene	ND		ug/kg	190	18.	1
1,2-Dichlorobenzene	ND		ug/kg	190	33.	1
1,3-Dichlorobenzene	ND		ug/kg	190	32.	1
1,4-Dichlorobenzene	ND		ug/kg	190	32.	1
3,3'-Dichlorobenzidine	ND		ug/kg	190	50.	1
2,4-Dinitrotoluene	ND		ug/kg	190	37.	1
2,6-Dinitrotoluene	ND		ug/kg	190	32.	1
Fluoranthene	ND		ug/kg	110	21.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	190	20.	1
4-Bromophenyl phenyl ether	ND		ug/kg	190	28.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	220	32.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	200	19.	1
Hexachlorobutadiene	ND		ug/kg	190	27.	1
Hexachlorocyclopentadiene	ND		ug/kg	530	170	1
Hexachloroethane	ND		ug/kg	150	30.	1
Isophorone	ND		ug/kg	170	24.	1
Naphthalene	ND		ug/kg	190	23.	1
Nitrobenzene	ND		ug/kg	170	28.	1
NDPA/DPA	ND		ug/kg	150	21.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	190	29.	1
Bis(2-ethylhexyl)phthalate	ND		ug/kg	190	64.	1
Butyl benzyl phthalate	ND		ug/kg	190	47.	1
Di-n-butylphthalate	ND		ug/kg	190	35.	1
Di-n-octylphthalate	ND		ug/kg	190	63.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-06 Date Collected: 10/15/25 12:45

Client ID: P6SB10_2-3 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	190	17.	1
Dimethyl phthalate	ND		ug/kg	190	39.	1
Benzo(a)anthracene	ND		ug/kg	110	21.	1
Benzo(a)pyrene	ND		ug/kg	150	45.	1
Benzo(b)fluoranthene	ND		ug/kg	110	31.	1
Benzo(k)fluoranthene	ND		ug/kg	110	30.	1
Chrysene	ND		ug/kg	110	19.	1
Acenaphthylene	ND		ug/kg	150	29.	1
Anthracene	ND		ug/kg	110	36.	1
Benzo(ghi)perylene	ND		ug/kg	150	22.	1
Fluorene	ND		ug/kg	190	18.	1
Phenanthrene	ND		ug/kg	110	23.	1
Dibenzo(a,h)anthracene	ND		ug/kg	110	22.	1
Indeno(1,2,3-cd)pyrene	ND		ug/kg	150	26.	1
Pyrene	ND		ug/kg	110	18.	1
Biphenyl	ND		ug/kg	420	24.	1
4-Chloroaniline	ND		ug/kg	190	34.	1
2-Nitroaniline	ND		ug/kg	190	36.	1
3-Nitroaniline	ND		ug/kg	190	35.	1
4-Nitroaniline	ND		ug/kg	190	77.	1
Dibenzofuran	ND		ug/kg	190	18.	1
2-Methylnaphthalene	ND		ug/kg	220	22.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	190	19.	1
Acetophenone	ND		ug/kg	190	23.	1
2,4,6-Trichlorophenol	ND		ug/kg	110	35.	1
p-Chloro-m-cresol	ND		ug/kg	190	28.	1
2-Chlorophenol	ND		ug/kg	190	22.	1
2,4-Dichlorophenol	ND		ug/kg	170	30.	1
2,4-Dimethylphenol	ND		ug/kg	190	61.	1
2-Nitrophenol	ND		ug/kg	400	70.	1
4-Nitrophenol	ND		ug/kg	260	76.	1
2,4-Dinitrophenol	ND		ug/kg	890	87.	1
4,6-Dinitro-o-cresol	ND		ug/kg	480	89.	1
Pentachlorophenol	ND		ug/kg	150	41.	1
Phenol	ND		ug/kg	190	28.	1
2-Methylphenol	ND		ug/kg	190	29.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	270	29.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-06 Date Collected: 10/15/25 12:45

Client ID: P6SB10_2-3 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	190	36.	1
Benzoic Acid	ND		ug/kg	600	190	1
Benzyl Alcohol	ND		ug/kg	190	57.	1
Carbazole	ND		ug/kg	190	18.	1
1,4-Dioxane	ND		ug/kg	28	8.6	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	38		25-120
Phenol-d6	42		10-120
Nitrobenzene-d5	38		23-120
2-Fluorobiphenyl	48		30-120
2,4,6-Tribromophenol	74		10-136
4-Terphenyl-d14	69		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-07
Client ID: P6SB07_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 13:45
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/18/25 03:56
Analyst: IMK
Percent Solids: 84%

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	420		ug/kg	150	20.	1
1,2,4-Trichlorobenzene	ND		ug/kg	190	22.	1
Hexachlorobenzene	ND		ug/kg	120	22.	1
Bis(2-chloroethyl)ether	ND		ug/kg	170	26.	1
2-Chloronaphthalene	ND		ug/kg	190	19.	1
1,2-Dichlorobenzene	ND		ug/kg	190	35.	1
1,3-Dichlorobenzene	ND		ug/kg	190	33.	1
1,4-Dichlorobenzene	ND		ug/kg	190	34.	1
3,3'-Dichlorobenzidine	ND		ug/kg	190	52.	1
2,4-Dinitrotoluene	ND		ug/kg	190	39.	1
2,6-Dinitrotoluene	ND		ug/kg	190	33.	1
Fluoranthene	5100		ug/kg	120	22.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	190	21.	1
4-Bromophenyl phenyl ether	ND		ug/kg	190	30.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	230	33.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	210	19.	1
Hexachlorobutadiene	ND		ug/kg	190	28.	1
Hexachlorocyclopentadiene	ND		ug/kg	550	180	1
Hexachloroethane	ND		ug/kg	150	31.	1
Isophorone	ND		ug/kg	170	25.	1
Naphthalene	760		ug/kg	190	24.	1
Nitrobenzene	ND		ug/kg	170	29.	1
NDPA/DPA	ND		ug/kg	150	22.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	190	30.	1
Bis(2-ethylhexyl)phthalate	91	J	ug/kg	190	67.	1
Butyl benzyl phthalate	ND		ug/kg	190	49.	1
Di-n-butylphthalate	ND		ug/kg	190	37.	1
Di-n-octylphthalate	ND		ug/kg	190	66.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-07 Date Collected: 10/15/25 13:45

Client ID: P6SB07_1-2 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	190	18.	1
Dimethyl phthalate	ND		ug/kg	190	41.	1
Benzo(a)anthracene	2800		ug/kg	120	22.	1
Benzo(a)pyrene	2900		ug/kg	150	47.	1
Benzo(b)fluoranthene	3700		ug/kg	120	33.	1
Benzo(k)fluoranthene	970		ug/kg	120	31.	1
Chrysene	2500		ug/kg	120	20.	1
Acenaphthylene	320		ug/kg	150	30.	1
Anthracene	940		ug/kg	120	38.	1
Benzo(ghi)perylene	1700		ug/kg	150	23.	1
Fluorene	410		ug/kg	190	19.	1
Phenanthrene	3900		ug/kg	120	24.	1
Dibenzo(a,h)anthracene	440		ug/kg	120	22.	1
Indeno(1,2,3-cd)pyrene	1400		ug/kg	150	27.	1
Pyrene	4300		ug/kg	120	19.	1
Biphenyl	83	J	ug/kg	440	25.	1
4-Chloroaniline	ND		ug/kg	190	35.	1
2-Nitroaniline	ND		ug/kg	190	37.	1
3-Nitroaniline	ND		ug/kg	190	36.	1
4-Nitroaniline	ND		ug/kg	190	80.	1
Dibenzofuran	410		ug/kg	190	18.	1
2-Methylnaphthalene	340		ug/kg	230	23.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	190	20.	1
Acetophenone	ND		ug/kg	190	24.	1
2,4,6-Trichlorophenol	ND		ug/kg	120	37.	1
p-Chloro-m-cresol	ND		ug/kg	190	29.	1
2-Chlorophenol	ND		ug/kg	190	23.	1
2,4-Dichlorophenol	ND		ug/kg	170	31.	1
2,4-Dimethylphenol	ND		ug/kg	190	64.	1
2-Nitrophenol	ND		ug/kg	420	73.	1
4-Nitrophenol	ND		ug/kg	270	79.	1
2,4-Dinitrophenol	ND		ug/kg	930	90.	1
4,6-Dinitro-o-cresol	ND		ug/kg	500	93.	1
Pentachlorophenol	ND		ug/kg	150	43.	1
Phenol	65	J	ug/kg	190	29.	1
2-Methylphenol	40	J	ug/kg	190	30.	1
3-Methylphenol/4-Methylphenol	110	J	ug/kg	280	30.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-07 Date Collected: 10/15/25 13:45

Client ID: P6SB07_1-2 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	190	37.	1
Benzoic Acid	ND		ug/kg	630	200	1
Benzyl Alcohol	ND		ug/kg	190	59.	1
Carbazole	430		ug/kg	190	19.	1
1,4-Dioxane	ND		ug/kg	29	8.9	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	60		25-120
Phenol-d6	64		10-120
Nitrobenzene-d5	67		23-120
2-Fluorobiphenyl	72		30-120
2,4,6-Tribromophenol	91		10-136
4-Terphenyl-d14	72		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-08
Client ID: P6SB07_2-3
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 14:15
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/18/25 01:49
Analyst: IMK
Percent Solids: 84%

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	60	J	ug/kg	160	20.	1
1,2,4-Trichlorobenzene	ND		ug/kg	190	22.	1
Hexachlorobenzene	ND		ug/kg	120	22.	1
Bis(2-chloroethyl)ether	ND		ug/kg	180	26.	1
2-Chloronaphthalene	ND		ug/kg	190	19.	1
1,2-Dichlorobenzene	ND		ug/kg	190	35.	1
1,3-Dichlorobenzene	ND		ug/kg	190	33.	1
1,4-Dichlorobenzene	ND		ug/kg	190	34.	1
3,3'-Dichlorobenzidine	ND		ug/kg	190	52.	1
2,4-Dinitrotoluene	ND		ug/kg	190	39.	1
2,6-Dinitrotoluene	ND		ug/kg	190	33.	1
Fluoranthene	2200		ug/kg	120	22.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	190	21.	1
4-Bromophenyl phenyl ether	ND		ug/kg	190	30.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	230	33.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	210	19.	1
Hexachlorobutadiene	ND		ug/kg	190	28.	1
Hexachlorocyclopentadiene	ND		ug/kg	560	180	1
Hexachloroethane	ND		ug/kg	160	31.	1
Isophorone	ND		ug/kg	180	25.	1
Naphthalene	190		ug/kg	190	24.	1
Nitrobenzene	ND		ug/kg	180	29.	1
NDPA/DPA	ND		ug/kg	160	22.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	190	30.	1
Bis(2-ethylhexyl)phthalate	ND		ug/kg	190	67.	1
Butyl benzyl phthalate	ND		ug/kg	190	49.	1
Di-n-butylphthalate	ND		ug/kg	190	37.	1
Di-n-octylphthalate	ND		ug/kg	190	66.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-08 Date Collected: 10/15/25 14:15

Client ID: P6SB07_2-3 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	190	18.	1
Dimethyl phthalate	ND		ug/kg	190	41.	1
Benzo(a)anthracene	1400		ug/kg	120	22.	1
Benzo(a)pyrene	1500		ug/kg	160	47.	1
Benzo(b)fluoranthene	1800		ug/kg	120	33.	1
Benzo(k)fluoranthene	640		ug/kg	120	31.	1
Chrysene	1200		ug/kg	120	20.	1
Acenaphthylene	180		ug/kg	160	30.	1
Anthracene	240		ug/kg	120	38.	1
Benzo(ghi)perylene	790		ug/kg	160	23.	1
Fluorene	72	J	ug/kg	190	19.	1
Phenanthrene	740		ug/kg	120	24.	1
Dibenzo(a,h)anthracene	230		ug/kg	120	22.	1
Indeno(1,2,3-cd)pyrene	730		ug/kg	160	27.	1
Pyrene	2000		ug/kg	120	19.	1
Biphenyl	ND		ug/kg	440	25.	1
4-Chloroaniline	ND		ug/kg	190	35.	1
2-Nitroaniline	ND		ug/kg	190	38.	1
3-Nitroaniline	ND		ug/kg	190	37.	1
4-Nitroaniline	ND		ug/kg	190	80.	1
Dibenzofuran	65	J	ug/kg	190	18.	1
2-Methylnaphthalene	64	J	ug/kg	230	24.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	190	20.	1
Acetophenone	ND		ug/kg	190	24.	1
2,4,6-Trichlorophenol	ND		ug/kg	120	37.	1
p-Chloro-m-cresol	ND		ug/kg	190	29.	1
2-Chlorophenol	ND		ug/kg	190	23.	1
2,4-Dichlorophenol	ND		ug/kg	180	31.	1
2,4-Dimethylphenol	ND		ug/kg	190	64.	1
2-Nitrophenol	ND		ug/kg	420	73.	1
4-Nitrophenol	ND		ug/kg	270	79.	1
2,4-Dinitrophenol	ND		ug/kg	930	91.	1
4,6-Dinitro-o-cresol	ND		ug/kg	500	93.	1
Pentachlorophenol	ND		ug/kg	160	43.	1
Phenol	32	J	ug/kg	190	29.	1
2-Methylphenol	ND		ug/kg	190	30.	1
3-Methylphenol/4-Methylphenol	47	J	ug/kg	280	30.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-08 Date Collected: 10/15/25 14:15

Client ID: P6SB07_2-3 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	190	37.	1
Benzoic Acid	ND		ug/kg	630	200	1
Benzyl Alcohol	ND		ug/kg	190	60.	1
Carbazole	68	J	ug/kg	190	19.	1
1,4-Dioxane	ND		ug/kg	29	9.0	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	48		25-120
Phenol-d6	48		10-120
Nitrobenzene-d5	53		23-120
2-Fluorobiphenyl	59		30-120
2,4,6-Tribromophenol	74		10-136
4-Terphenyl-d14	61		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-09
Client ID: P6SB06_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 14:30
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/22/25 12:38
Analyst: IMK
Percent Solids: 82%

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	140	J	ug/kg	160	20.	1
1,2,4-Trichlorobenzene	ND		ug/kg	200	22.	1
Hexachlorobenzene	ND		ug/kg	120	22.	1
Bis(2-chloroethyl)ether	ND		ug/kg	180	27.	1
2-Chloronaphthalene	ND		ug/kg	200	19.	1
1,2-Dichlorobenzene	ND		ug/kg	200	35.	1
1,3-Dichlorobenzene	ND		ug/kg	200	34.	1
1,4-Dichlorobenzene	ND		ug/kg	200	34.	1
3,3'-Dichlorobenzidine	ND		ug/kg	200	52.	1
2,4-Dinitrotoluene	ND		ug/kg	200	39.	1
2,6-Dinitrotoluene	ND		ug/kg	200	34.	1
Fluoranthene	4000		ug/kg	120	22.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	200	21.	1
4-Bromophenyl phenyl ether	ND		ug/kg	200	30.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	240	34.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	210	20.	1
Hexachlorobutadiene	ND		ug/kg	200	29.	1
Hexachlorocyclopentadiene	ND		ug/kg	560	180	1
Hexachloroethane	ND		ug/kg	160	32.	1
Isophorone	ND		ug/kg	180	25.	1
Naphthalene	180	J	ug/kg	200	24.	1
Nitrobenzene	ND		ug/kg	180	29.	1
NDPA/DPA	ND		ug/kg	160	22.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	200	30.	1
Bis(2-ethylhexyl)phthalate	160	J	ug/kg	200	68.	1
Butyl benzyl phthalate	ND		ug/kg	200	49.	1
Di-n-butylphthalate	ND		ug/kg	200	37.	1
Di-n-octylphthalate	ND		ug/kg	200	67.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-09 Date Collected: 10/15/25 14:30

Client ID: P6SB06_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	200	18.	1
Dimethyl phthalate	ND		ug/kg	200	41.	1
Benzo(a)anthracene	2300		ug/kg	120	22.	1
Benzo(a)pyrene	2000		ug/kg	160	48.	1
Benzo(b)fluoranthene	2800		ug/kg	120	33.	1
Benzo(k)fluoranthene	840		ug/kg	120	31.	1
Chrysene	2100		ug/kg	120	20.	1
Acenaphthylene	280		ug/kg	160	30.	1
Anthracene	560		ug/kg	120	38.	1
Benzo(ghi)perylene	1300		ug/kg	160	23.	1
Fluorene	190	J	ug/kg	200	19.	1
Phenanthrene	1900		ug/kg	120	24.	1
Dibenzo(a,h)anthracene	310		ug/kg	120	23.	1
Indeno(1,2,3-cd)pyrene	1400		ug/kg	160	27.	1
Pyrene	3200		ug/kg	120	19.	1
Biphenyl	ND		ug/kg	450	26.	1
4-Chloroaniline	ND		ug/kg	200	36.	1
2-Nitroaniline	ND		ug/kg	200	38.	1
3-Nitroaniline	ND		ug/kg	200	37.	1
4-Nitroaniline	ND		ug/kg	200	81.	1
Dibenzofuran	140	J	ug/kg	200	18.	1
2-Methylnaphthalene	100	J	ug/kg	240	24.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	200	20.	1
Acetophenone	ND		ug/kg	200	24.	1
2,4,6-Trichlorophenol	ND		ug/kg	120	37.	1
p-Chloro-m-cresol	ND		ug/kg	200	29.	1
2-Chlorophenol	ND		ug/kg	200	23.	1
2,4-Dichlorophenol	ND		ug/kg	180	32.	1
2,4-Dimethylphenol	ND		ug/kg	200	65.	1
2-Nitrophenol	ND		ug/kg	420	74.	1
4-Nitrophenol	ND		ug/kg	270	80.	1
2,4-Dinitrophenol	ND		ug/kg	940	91.	1
4,6-Dinitro-o-cresol	ND		ug/kg	510	94.	1
Pentachlorophenol	ND		ug/kg	160	43.	1
Phenol	ND		ug/kg	200	30.	1
2-Methylphenol	ND		ug/kg	200	30.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	280	31.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-09 Date Collected: 10/15/25 14:30

Client ID: P6SB06_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	200	38.	1
Benzoic Acid	ND		ug/kg	640	200	1
Benzyl Alcohol	ND		ug/kg	200	60.	1
Carbazole	210		ug/kg	200	19.	1
1,4-Dioxane	ND		ug/kg	29	9.0	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	55		25-120
Phenol-d6	55		10-120
Nitrobenzene-d5	58		23-120
2-Fluorobiphenyl	71		30-120
2,4,6-Tribromophenol	76		10-136
4-Terphenyl-d14	68		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-10
Client ID: P6SB06_3-4
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 14:50
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/18/25 02:07
Analyst: IMK
Percent Solids: 85%

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	37	J	ug/kg	160	20.	1
1,2,4-Trichlorobenzene	27	J	ug/kg	190	22.	1
Hexachlorobenzene	ND		ug/kg	120	22.	1
Bis(2-chloroethyl)ether	ND		ug/kg	170	26.	1
2-Chloronaphthalene	ND		ug/kg	190	19.	1
1,2-Dichlorobenzene	ND		ug/kg	190	35.	1
1,3-Dichlorobenzene	34	J	ug/kg	190	33.	1
1,4-Dichlorobenzene	ND		ug/kg	190	34.	1
3,3'-Dichlorobenzidine	ND		ug/kg	190	52.	1
2,4-Dinitrotoluene	ND		ug/kg	190	39.	1
2,6-Dinitrotoluene	ND		ug/kg	190	33.	1
Fluoranthene	820		ug/kg	120	22.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	190	21.	1
4-Bromophenyl phenyl ether	ND		ug/kg	190	30.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	230	33.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	210	19.	1
Hexachlorobutadiene	ND		ug/kg	190	28.	1
Hexachlorocyclopentadiene	ND		ug/kg	560	180	1
Hexachloroethane	ND		ug/kg	160	31.	1
Isophorone	ND		ug/kg	170	25.	1
Naphthalene	310		ug/kg	190	24.	1
Nitrobenzene	ND		ug/kg	170	29.	1
NDPA/DPA	ND		ug/kg	160	22.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	190	30.	1
Bis(2-ethylhexyl)phthalate	ND		ug/kg	190	67.	1
Butyl benzyl phthalate	ND		ug/kg	190	49.	1
Di-n-butylphthalate	ND		ug/kg	190	37.	1
Di-n-octylphthalate	ND		ug/kg	190	66.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-10 Date Collected: 10/15/25 14:50

Client ID: P6SB06_3-4 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	190	18.	1
Dimethyl phthalate	ND		ug/kg	190	41.	1
Benzo(a)anthracene	510		ug/kg	120	22.	1
Benzo(a)pyrene	580		ug/kg	160	47.	1
Benzo(b)fluoranthene	800		ug/kg	120	33.	1
Benzo(k)fluoranthene	230		ug/kg	120	31.	1
Chrysene	490		ug/kg	120	20.	1
Acenaphthylene	100	J	ug/kg	160	30.	1
Anthracene	120		ug/kg	120	38.	1
Benzo(ghi)perylene	390		ug/kg	160	23.	1
Fluorene	39	J	ug/kg	190	19.	1
Phenanthrene	420		ug/kg	120	24.	1
Dibenzo(a,h)anthracene	110	J	ug/kg	120	22.	1
Indeno(1,2,3-cd)pyrene	340		ug/kg	160	27.	1
Pyrene	700		ug/kg	120	19.	1
Biphenyl	ND		ug/kg	440	25.	1
4-Chloroaniline	ND		ug/kg	190	35.	1
2-Nitroaniline	ND		ug/kg	190	37.	1
3-Nitroaniline	ND		ug/kg	190	37.	1
4-Nitroaniline	ND		ug/kg	190	80.	1
Dibenzofuran	44	J	ug/kg	190	18.	1
2-Methylnaphthalene	68	J	ug/kg	230	23.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	190	20.	1
Acetophenone	ND		ug/kg	190	24.	1
2,4,6-Trichlorophenol	ND		ug/kg	120	37.	1
p-Chloro-m-cresol	ND		ug/kg	190	29.	1
2-Chlorophenol	ND		ug/kg	190	23.	1
2,4-Dichlorophenol	ND		ug/kg	170	31.	1
2,4-Dimethylphenol	ND		ug/kg	190	64.	1
2-Nitrophenol	ND		ug/kg	420	73.	1
4-Nitrophenol	ND		ug/kg	270	79.	1
2,4-Dinitrophenol	ND		ug/kg	930	90.	1
4,6-Dinitro-o-cresol	ND		ug/kg	500	93.	1
Pentachlorophenol	ND		ug/kg	160	43.	1
Phenol	ND		ug/kg	190	29.	1
2-Methylphenol	ND		ug/kg	190	30.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	280	30.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-10 Date Collected: 10/15/25 14:50

Client ID: P6SB06_3-4 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	190	37.	1
Benzoic Acid	ND		ug/kg	630	200	1
Benzyl Alcohol	ND		ug/kg	190	59.	1
Carbazole	49	J	ug/kg	190	19.	1
1,4-Dioxane	ND		ug/kg	29	8.9	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	49		25-120
Phenol-d6	51		10-120
Nitrobenzene-d5	54		23-120
2-Fluorobiphenyl	62		30-120
2,4,6-Tribromophenol	84		10-136
4-Terphenyl-d14	71		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/17/25 19:48
Analyst: IMK

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01-10 Batch: WG2128974-1					
Acenaphthene	ND		ug/kg	130	17.
1,2,4-Trichlorobenzene	ND		ug/kg	160	19.
Hexachlorobenzene	ND		ug/kg	98	18.
Bis(2-chloroethyl)ether	ND		ug/kg	150	22.
2-Chloronaphthalene	ND		ug/kg	160	16.
1,2-Dichlorobenzene	ND		ug/kg	160	29.
1,3-Dichlorobenzene	ND		ug/kg	160	28.
1,4-Dichlorobenzene	ND		ug/kg	160	28.
3,3'-Dichlorobenzidine	ND		ug/kg	160	43.
2,4-Dinitrotoluene	ND		ug/kg	160	32.
2,6-Dinitrotoluene	ND		ug/kg	160	28.
Fluoranthene	ND		ug/kg	98	19.
4-Chlorophenyl phenyl ether	ND		ug/kg	160	17.
4-Bromophenyl phenyl ether	ND		ug/kg	160	25.
Bis(2-chloroisopropyl)ether	ND		ug/kg	200	28.
Bis(2-chloroethoxy)methane	ND		ug/kg	180	16.
Hexachlorobutadiene	ND		ug/kg	160	24.
Hexachlorocyclopentadiene	ND		ug/kg	460	150
Hexachloroethane	ND		ug/kg	130	26.
Isophorone	ND		ug/kg	150	21.
Naphthalene	ND		ug/kg	160	20.
Nitrobenzene	ND		ug/kg	150	24.
NDPA/DPA	ND		ug/kg	130	18.
n-Nitrosodi-n-propylamine	ND		ug/kg	160	25.

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/17/25 19:48
Analyst: IMK

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01-10 Batch: WG2128974-1					
Bis(2-ethylhexyl)phthalate	ND		ug/kg	160	56.
Butyl benzyl phthalate	ND		ug/kg	160	41.
Di-n-butylphthalate	ND		ug/kg	160	31.
Di-n-octylphthalate	ND		ug/kg	160	55.
Diethyl phthalate	ND		ug/kg	160	15.
Dimethyl phthalate	ND		ug/kg	160	34.
Benzo(a)anthracene	ND		ug/kg	98	18.
Benzo(a)pyrene	ND		ug/kg	130	40.
Benzo(b)fluoranthene	ND		ug/kg	98	27.
Benzo(k)fluoranthene	ND		ug/kg	98	26.
Chrysene	ND		ug/kg	98	17.
Acenaphthylene	ND		ug/kg	130	25.
Anthracene	ND		ug/kg	98	32.
Benzo(ghi)perylene	ND		ug/kg	130	19.
Fluorene	ND		ug/kg	160	16.
Phenanthrene	ND		ug/kg	98	20.
Dibenzo(a,h)anthracene	ND		ug/kg	98	19.
Indeno(1,2,3-cd)pyrene	ND		ug/kg	130	23.
Pyrene	ND		ug/kg	98	16.
Biphenyl	ND		ug/kg	370	21.
4-Chloroaniline	ND		ug/kg	160	30.
2-Nitroaniline	ND		ug/kg	160	31.
3-Nitroaniline	ND		ug/kg	160	31.
4-Nitroaniline	ND		ug/kg	160	67.

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/17/25 19:48
Analyst: IMK

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01-10 Batch: WG2128974-1					
Dibenzofuran	ND		ug/kg	160	15.
2-Methylnaphthalene	ND		ug/kg	200	20.
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	160	17.
Acetophenone	ND		ug/kg	160	20.
2,4,6-Trichlorophenol	ND		ug/kg	98	31.
p-Chloro-m-cresol	ND		ug/kg	160	24.
2-Chlorophenol	ND		ug/kg	160	19.
2,4-Dichlorophenol	ND		ug/kg	150	26.
2,4-Dimethylphenol	ND		ug/kg	160	54.
2-Nitrophenol	ND		ug/kg	350	61.
4-Nitrophenol	ND		ug/kg	230	66.
2,4-Dinitrophenol	ND		ug/kg	780	76.
4,6-Dinitro-o-cresol	ND		ug/kg	420	78.
Pentachlorophenol	ND		ug/kg	130	36.
Phenol	ND		ug/kg	160	24.
2-Methylphenol	ND		ug/kg	160	25.
3-Methylphenol/4-Methylphenol	ND		ug/kg	230	25.
2,4,5-Trichlorophenol	ND		ug/kg	160	31.
Benzoic Acid	ND		ug/kg	530	160
Benzyl Alcohol	ND		ug/kg	160	50.
Carbazole	ND		ug/kg	160	16.
1,4-Dioxane	ND		ug/kg	24	7.5

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/17/25 19:48
Analyst: IMK

Extraction Method: EPA 3546
Extraction Date: 10/16/25 23:51

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01-10 Batch: WG2128974-1					

Surrogate	%Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	66		25-120
Phenol-d6	63		10-120
Nitrobenzene-d5	59		23-120
2-Fluorobiphenyl	64		30-120
2,4,6-Tribromophenol	76		10-136
4-Terphenyl-d14	73		18-120

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-10 Batch: WG2128974-2 WG2128974-3								
Acenaphthene	83		74		31-137	11		50
1,2,4-Trichlorobenzene	77		70		38-107	10		50
Hexachlorobenzene	96		82		40-140	16		50
Bis(2-chloroethyl)ether	71		64		40-140	10		50
2-Chloronaphthalene	82		72		40-140	13		50
1,2-Dichlorobenzene	73		67		40-140	9		50
1,3-Dichlorobenzene	73		66		40-140	10		50
1,4-Dichlorobenzene	72		67		28-104	7		50
3,3'-Dichlorobenzidine	64		57		40-140	12		50
2,4-Dinitrotoluene	94		79		40-132	17		50
2,6-Dinitrotoluene	90		76		40-140	17		50
Fluoranthene	81		72		40-140	12		50
4-Chlorophenyl phenyl ether	88		78		40-140	12		50
4-Bromophenyl phenyl ether	92		80		40-140	14		50
Bis(2-chloroisopropyl)ether	51		45		40-140	13		50
Bis(2-chloroethoxy)methane	78		70		40-117	11		50
Hexachlorobutadiene	79		73		40-140	8		50
Hexachlorocyclopentadiene	94		87		40-140	8		50
Hexachloroethane	73		68		40-140	7		50

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-10 Batch: WG2128974-2 WG2128974-3								
Isophorone	79		69		40-140	14		50
Naphthalene	77		70		40-140	10		50
Nitrobenzene	75		67		40-140	11		50
NDPA/DPA	87		76		36-157	13		50
n-Nitrosodi-n-propylamine	78		68		32-121	14		50
Bis(2-ethylhexyl)phthalate	100		90		40-140	11		50
Butyl benzyl phthalate	90		82		40-140	9		50
Di-n-butylphthalate	90		80		40-140	12		50
Di-n-octylphthalate	102		93		40-140	9		50
Diethyl phthalate	91		79		40-140	14		50
Dimethyl phthalate	88		75		40-140	16		50
Benzo(a)anthracene	81		72		40-140	12		50
Benzo(a)pyrene	87		82		40-140	6		50
Benzo(b)fluoranthene	82		78		40-140	5		50
Benzo(k)fluoranthene	87		80		40-140	8		50
Chrysene	81		74		40-140	9		50
Acenaphthylene	84		74		40-140	13		50
Anthracene	83		74		40-140	11		50
Benzo(ghi)perylene	76		70		40-140	8		50

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-10 Batch: WG2128974-2 WG2128974-3								
Fluorene	84		75		40-140	11		50
Phenanthrene	80		73		40-140	9		50
Dibenzo(a,h)anthracene	83		76		40-140	9		50
Indeno(1,2,3-cd)pyrene	82		75		40-140	9		50
Pyrene	80		72		35-142	11		50
Biphenyl	88		77		37-127	13		50
4-Chloroaniline	45		**34**	Q	40-140	28		50
2-Nitroaniline	91		78		47-134	15		50
3-Nitroaniline	64		51		26-129	23		50
4-Nitroaniline	95		81		41-125	16		50
Dibenzofuran	84		76		40-140	10		50
2-Methylnaphthalene	83		74		40-140	11		50
1,2,4,5-Tetrachlorobenzene	87		78		40-117	11		50
Acetophenone	92		81		14-144	13		50
2,4,6-Trichlorophenol	93		83		30-130	11		50
p-Chloro-m-cresol	91		80		26-103	13		50
2-Chlorophenol	80		72		25-102	11		50
2,4-Dichlorophenol	88		77		30-130	13		50
2,4-Dimethylphenol	86		77		30-130	11		50

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-10 Batch: WG2128974-2 WG2128974-3								
2-Nitrophenol	86		76		30-130	12		50
4-Nitrophenol	98		85		11-114	14		50
2,4-Dinitrophenol	91		82		4-130	10		50
4,6-Dinitro-o-cresol	109		92		10-130	17		50
Pentachlorophenol	96		83		17-109	15		50
Phenol	78		69		26-90	12		50
2-Methylphenol	83		74		30-130	11		50
3-Methylphenol/4-Methylphenol	84		74		30-130	13		50
2,4,5-Trichlorophenol	97		82		30-130	17		50
Benzoic Acid	82		76		10-110	8		50
Benzyl Alcohol	88		78		40-140	12		50
Carbazole	82		73		54-128	12		50
1,4-Dioxane	48		47		40-140	2		50

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits

Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-10 Batch: WG2128974-2 WG2128974-3

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria
2-Fluorophenol	78		70		25-120
Phenol-d6	79		70		10-120
Nitrobenzene-d5	73		65		23-120
2-Fluorobiphenyl	80		71		30-120
2,4,6-Tribromophenol	109		93		10-136
4-Terphenyl-d14	80		71		18-120

PCBS

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-01
Client ID: P6SB03_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 09:40
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/17/25 13:38
Analyst: EMR
Percent Solids: 85%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 00:40
Cleanup Method: EPA 3665A
Cleanup Date: 10/17/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/17/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	55.1	4.90	1	A
Aroclor 1221	ND		ug/kg	55.1	5.52	1	A
Aroclor 1232	ND		ug/kg	55.1	11.7	1	A
Aroclor 1242	ND		ug/kg	55.1	7.43	1	A
Aroclor 1248	ND		ug/kg	55.1	8.27	1	A
Aroclor 1254	ND		ug/kg	55.1	6.03	1	A
Aroclor 1260	ND		ug/kg	55.1	10.2	1	A
Aroclor 1262	ND		ug/kg	55.1	7.00	1	A
Aroclor 1268	ND		ug/kg	55.1	5.71	1	A
PCBs, Total	ND		ug/kg	55.1	4.90	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	83		30-150	A
Decachlorobiphenyl	56		30-150	A
2,4,5,6-Tetrachloro-m-xylene	82		30-150	B
Decachlorobiphenyl	60		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-02
Client ID: P6SB03_4-5
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 10:00
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/17/25 13:48
Analyst: EMR
Percent Solids: 88%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 00:40
Cleanup Method: EPA 3665A
Cleanup Date: 10/17/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/17/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	53.6	4.76	1	A
Aroclor 1221	ND		ug/kg	53.6	5.37	1	A
Aroclor 1232	ND		ug/kg	53.6	11.4	1	A
Aroclor 1242	ND		ug/kg	53.6	7.22	1	A
Aroclor 1248	ND		ug/kg	53.6	8.04	1	A
Aroclor 1254	ND		ug/kg	53.6	5.86	1	A
Aroclor 1260	ND		ug/kg	53.6	9.91	1	A
Aroclor 1262	ND		ug/kg	53.6	6.81	1	A
Aroclor 1268	ND		ug/kg	53.6	5.55	1	A
PCBs, Total	ND		ug/kg	53.6	4.76	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	86		30-150	A
Decachlorobiphenyl	56		30-150	A
2,4,5,6-Tetrachloro-m-xylene	85		30-150	B
Decachlorobiphenyl	59		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565313
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-03
Client ID: P6SB04_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 11:00
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/17/25 13:58
Analyst: EMR
Percent Solids: 83%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 00:40
Cleanup Method: EPA 3665A
Cleanup Date: 10/17/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/17/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	56.2	4.99	1	A
Aroclor 1221	ND		ug/kg	56.2	5.63	1	A
Aroclor 1232	ND		ug/kg	56.2	11.9	1	A
Aroclor 1242	ND		ug/kg	56.2	7.57	1	A
Aroclor 1248	ND		ug/kg	56.2	8.43	1	A
Aroclor 1254	ND		ug/kg	56.2	6.15	1	A
Aroclor 1260	15.8	J	ug/kg	56.2	10.4	1	B
Aroclor 1262	ND		ug/kg	56.2	7.13	1	A
Aroclor 1268	6.98	J	ug/kg	56.2	5.82	1	B
PCBs, Total	22.8	J	ug/kg	56.2	4.99	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	77		30-150	A
Decachlorobiphenyl	56		30-150	A
2,4,5,6-Tetrachloro-m-xylene	77		30-150	B
Decachlorobiphenyl	64		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565313
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-04
Client ID: P6SB04_4-5
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 11:40
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/17/25 14:08
Analyst: EMR
Percent Solids: 76%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 00:40
Cleanup Method: EPA 3665A
Cleanup Date: 10/17/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/17/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	65.0	5.77	1	A
Aroclor 1221	ND		ug/kg	65.0	6.51	1	A
Aroclor 1232	ND		ug/kg	65.0	13.8	1	A
Aroclor 1242	ND		ug/kg	65.0	8.76	1	A
Aroclor 1248	ND		ug/kg	65.0	9.75	1	A
Aroclor 1254	ND		ug/kg	65.0	7.11	1	A
Aroclor 1260	ND		ug/kg	65.0	12.0	1	A
Aroclor 1262	ND		ug/kg	65.0	8.25	1	A
Aroclor 1268	ND		ug/kg	65.0	6.73	1	A
PCBs, Total	ND		ug/kg	65.0	5.77	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	82		30-150	A
Decachlorobiphenyl	58		30-150	A
2,4,5,6-Tetrachloro-m-xylene	84		30-150	B
Decachlorobiphenyl	61		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-05
Client ID: P6SB10_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 12:20
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/17/25 14:18
Analyst: EMR
Percent Solids: 89%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 00:40
Cleanup Method: EPA 3665A
Cleanup Date: 10/17/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/17/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	53.8	4.78	1	A
Aroclor 1221	ND		ug/kg	53.8	5.39	1	A
Aroclor 1232	ND		ug/kg	53.8	11.4	1	A
Aroclor 1242	ND		ug/kg	53.8	7.25	1	A
Aroclor 1248	ND		ug/kg	53.8	8.07	1	A
Aroclor 1254	ND		ug/kg	53.8	5.88	1	A
Aroclor 1260	11.8	J	ug/kg	53.8	9.94	1	B
Aroclor 1262	ND		ug/kg	53.8	6.83	1	A
Aroclor 1268	ND		ug/kg	53.8	5.57	1	A
PCBs, Total	11.8	J	ug/kg	53.8	4.78	1	B

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	86		30-150	A
Decachlorobiphenyl	62		30-150	A
2,4,5,6-Tetrachloro-m-xylene	85		30-150	B
Decachlorobiphenyl	66		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-06
Client ID: P6SB10_2-3
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 12:45
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/17/25 14:28
Analyst: EMR
Percent Solids: 87%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 00:40
Cleanup Method: EPA 3665A
Cleanup Date: 10/17/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/17/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	54.3	4.82	1	A
Aroclor 1221	ND		ug/kg	54.3	5.44	1	A
Aroclor 1232	ND		ug/kg	54.3	11.5	1	A
Aroclor 1242	ND		ug/kg	54.3	7.32	1	A
Aroclor 1248	ND		ug/kg	54.3	8.14	1	A
Aroclor 1254	ND		ug/kg	54.3	5.94	1	A
Aroclor 1260	ND		ug/kg	54.3	10.0	1	A
Aroclor 1262	ND		ug/kg	54.3	6.89	1	A
Aroclor 1268	ND		ug/kg	54.3	5.62	1	A
PCBs, Total	ND		ug/kg	54.3	4.82	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	89		30-150	A
Decachlorobiphenyl	65		30-150	A
2,4,5,6-Tetrachloro-m-xylene	88		30-150	B
Decachlorobiphenyl	66		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-07
Client ID: P6SB07_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 13:45
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/17/25 16:13
Analyst: EMR
Percent Solids: 84%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 00:40
Cleanup Method: EPA 3665A
Cleanup Date: 10/17/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/17/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	58.3	5.18	1	A
Aroclor 1221	ND		ug/kg	58.3	5.84	1	A
Aroclor 1232	ND		ug/kg	58.3	12.4	1	A
Aroclor 1242	ND		ug/kg	58.3	7.86	1	A
Aroclor 1248	ND		ug/kg	58.3	8.74	1	A
Aroclor 1254	ND		ug/kg	58.3	6.38	1	A
Aroclor 1260	ND		ug/kg	58.3	10.8	1	B
Aroclor 1262	ND		ug/kg	58.3	7.40	1	A
Aroclor 1268	ND		ug/kg	58.3	6.04	1	A
PCBs, Total	ND		ug/kg	58.3	5.18	1	B

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	86		30-150	A
Decachlorobiphenyl	75		30-150	A
2,4,5,6-Tetrachloro-m-xylene	85		30-150	B
Decachlorobiphenyl	80		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-08
Client ID: P6SB07_2-3
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 14:15
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/17/25 16:24
Analyst: EMR
Percent Solids: 84%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 00:40
Cleanup Method: EPA 3665A
Cleanup Date: 10/17/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/17/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	58.4	5.19	1	A
Aroclor 1221	ND		ug/kg	58.4	5.85	1	A
Aroclor 1232	ND		ug/kg	58.4	12.4	1	A
Aroclor 1242	ND		ug/kg	58.4	7.87	1	A
Aroclor 1248	ND		ug/kg	58.4	8.76	1	A
Aroclor 1254	ND		ug/kg	58.4	6.39	1	A
Aroclor 1260	ND		ug/kg	58.4	10.8	1	A
Aroclor 1262	ND		ug/kg	58.4	7.42	1	A
Aroclor 1268	ND		ug/kg	58.4	6.05	1	A
PCBs, Total	ND		ug/kg	58.4	5.19	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	82		30-150	A
Decachlorobiphenyl	67		30-150	A
2,4,5,6-Tetrachloro-m-xylene	80		30-150	B
Decachlorobiphenyl	74		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565313
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-09
Client ID: P6SB06_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 14:30
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/17/25 16:34
Analyst: EMR
Percent Solids: 82%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 00:40
Cleanup Method: EPA 3665A
Cleanup Date: 10/17/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/17/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	60.4	5.36	1	A
Aroclor 1221	ND		ug/kg	60.4	6.05	1	A
Aroclor 1232	ND		ug/kg	60.4	12.8	1	A
Aroclor 1242	ND		ug/kg	60.4	8.14	1	A
Aroclor 1248	ND		ug/kg	60.4	9.06	1	A
Aroclor 1254	ND		ug/kg	60.4	6.61	1	A
Aroclor 1260	16.8	J	ug/kg	60.4	11.2	1	A
Aroclor 1262	ND		ug/kg	60.4	7.67	1	A
Aroclor 1268	6.46	J	ug/kg	60.4	6.26	1	B
PCBs, Total	23.3	J	ug/kg	60.4	5.36	1	B

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	81		30-150	A
Decachlorobiphenyl	67		30-150	A
2,4,5,6-Tetrachloro-m-xylene	82		30-150	B
Decachlorobiphenyl	73		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565313
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-10
Client ID: P6SB06_3-4
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 14:50
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/17/25 16:43
Analyst: EMR
Percent Solids: 85%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 00:40
Cleanup Method: EPA 3665A
Cleanup Date: 10/17/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/17/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	57.4	5.09	1	A
Aroclor 1221	ND		ug/kg	57.4	5.75	1	A
Aroclor 1232	ND		ug/kg	57.4	12.2	1	A
Aroclor 1242	ND		ug/kg	57.4	7.73	1	A
Aroclor 1248	ND		ug/kg	57.4	8.60	1	A
Aroclor 1254	ND		ug/kg	57.4	6.27	1	A
Aroclor 1260	ND		ug/kg	57.4	10.6	1	A
Aroclor 1262	ND		ug/kg	57.4	7.28	1	A
Aroclor 1268	ND		ug/kg	57.4	5.94	1	A
PCBs, Total	ND		ug/kg	57.4	5.09	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	80		30-150	A
Decachlorobiphenyl	64		30-150	A
2,4,5,6-Tetrachloro-m-xylene	80		30-150	B
Decachlorobiphenyl	67		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8082A
Analytical Date: 10/17/25 12:58
Analyst: EMR

Extraction Method: EPA 3546
Extraction Date: 10/17/25 00:40
Cleanup Method: EPA 3665A
Cleanup Date: 10/17/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/17/25

Parameter	Result	Qualifier	Units	RL	MDL	Column
Polychlorinated Biphenyls by GC - Westborough Lab for sample(s): 01-10 Batch: WG2128989-1						
Aroclor 1016	ND		ug/kg	49.5	4.40	A
Aroclor 1221	ND		ug/kg	49.5	4.96	A
Aroclor 1232	ND		ug/kg	49.5	10.5	A
Aroclor 1242	ND		ug/kg	49.5	6.67	A
Aroclor 1248	ND		ug/kg	49.5	7.42	A
Aroclor 1254	ND		ug/kg	49.5	5.42	A
Aroclor 1260	ND		ug/kg	49.5	9.15	A
Aroclor 1262	ND		ug/kg	49.5	6.29	A
Aroclor 1268	ND		ug/kg	49.5	5.13	A
PCBs, Total	ND		ug/kg	49.5	4.40	A

Surrogate	%Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	100		30-150	A
Decachlorobiphenyl	74		30-150	A
2,4,5,6-Tetrachloro-m-xylene	99		30-150	B
Decachlorobiphenyl	80		30-150	B

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits	Column
Polychlorinated Biphenyls by GC - Westborough Lab Associated sample(s): 01-10 Batch: WG2128989-2 WG2128989-3									
Aroclor 1016	101		99		40-140	2		50	A
Aroclor 1260	86		90		40-140	5		50	A

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	96		98		30-150	A
Decachlorobiphenyl	72		76		30-150	A
2,4,5,6-Tetrachloro-m-xylene	94		97		30-150	B
Decachlorobiphenyl	75		76		30-150	B

PESTICIDES

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565313
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-01
Client ID: P6SB03_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 09:40
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8081B
Analytical Date: 10/18/25 11:26
Analyst: PEG
Percent Solids: 85%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 09:17
Cleanup Method: EPA 3620B
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							
Delta-BHC	ND		ug/kg	1.83	0.359	1	A
Lindane	ND		ug/kg	0.763	0.341	1	A
Alpha-BHC	ND		ug/kg	0.763	0.217	1	A
Beta-BHC	ND		ug/kg	1.83	0.695	1	A
Heptachlor	ND		ug/kg	0.916	0.411	1	A
Aldrin	ND		ug/kg	1.83	0.645	1	A
Heptachlor epoxide	ND		ug/kg	3.44	1.03	1	A
Endrin	ND		ug/kg	0.763	0.313	1	A
Endrin aldehyde	ND		ug/kg	2.29	0.802	1	A
Endrin ketone	ND		ug/kg	1.83	0.472	1	A
Dieldrin	ND		ug/kg	1.14	0.572	1	A
4,4'-DDE	7.23		ug/kg	1.83	0.424	1	B
4,4'-DDD	ND		ug/kg	1.83	0.654	1	A
4,4'-DDT	4.34		ug/kg	1.83	1.47	1	A
Endosulfan I	ND		ug/kg	1.83	0.433	1	A
Endosulfan II	ND		ug/kg	1.83	0.612	1	A
Endosulfan sulfate	ND		ug/kg	0.763	0.363	1	A
Methoxychlor	ND		ug/kg	3.44	1.07	1	A
Toxaphene	ND		ug/kg	34.4	9.62	1	A
cis-Chlordane	ND	IP	ug/kg	2.29	0.638	1	B
trans-Chlordane	0.655	J	ug/kg	2.29	0.605	1	B
Chlordane	ND		ug/kg	15.3	6.07	1	A

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-01 Date Collected: 10/15/25 09:40

Client ID: P6SB03_1-2 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	76		30-150	A
Decachlorobiphenyl	66		30-150	A
2,4,5,6-Tetrachloro-m-xylene	78		30-150	B
Decachlorobiphenyl	73		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565313
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-01
Client ID: P6SB03_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 09:40
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8151A
Analytical Date: 10/17/25 23:44
Analyst: JAG
Percent Solids: 85%
Methylation Date: 10/17/25 17:56

Extraction Method: EPA 8151A
Extraction Date: 10/16/25 19:06

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Chlorinated Herbicides by GC - Westborough Lab							
2,4-D	ND		ug/kg	193	12.2	1	A
2,4,5-T	ND		ug/kg	193	5.99	1	A
2,4,5-TP (Silvex)	ND		ug/kg	193	5.14	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
DCAA	35		30-150	A
DCAA	40		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-03
Client ID: P6SB04_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 11:00
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8081B
Analytical Date: 10/18/25 11:37
Analyst: PEG
Percent Solids: 83%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 09:17
Cleanup Method: EPA 3620B
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							
Delta-BHC	ND		ug/kg	1.89	0.370	1	A
Lindane	ND		ug/kg	0.788	0.352	1	A
Alpha-BHC	ND		ug/kg	0.788	0.224	1	A
Beta-BHC	ND		ug/kg	1.89	0.717	1	A
Heptachlor	ND		ug/kg	0.946	0.424	1	A
Aldrin	ND		ug/kg	1.89	0.666	1	A
Heptachlor epoxide	ND		ug/kg	3.55	1.06	1	A
Endrin	ND		ug/kg	0.788	0.323	1	A
Endrin aldehyde	ND		ug/kg	2.36	0.827	1	A
Endrin ketone	ND		ug/kg	1.89	0.487	1	A
Dieldrin	ND		ug/kg	1.18	0.591	1	A
4,4'-DDE	15.1		ug/kg	1.89	0.437	1	B
4,4'-DDD	ND		ug/kg	1.89	0.674	1	A
4,4'-DDT	10.6		ug/kg	1.89	1.52	1	B
Endosulfan I	ND		ug/kg	1.89	0.447	1	A
Endosulfan II	ND		ug/kg	1.89	0.632	1	A
Endosulfan sulfate	ND		ug/kg	0.788	0.375	1	A
Methoxychlor	ND		ug/kg	3.55	1.10	1	A
Toxaphene	ND		ug/kg	35.5	9.93	1	A
cis-Chlordane	ND		ug/kg	2.36	0.659	1	A
trans-Chlordane	ND		ug/kg	2.36	0.624	1	A
Chlordane	ND		ug/kg	15.8	6.26	1	A

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-03 Date Collected: 10/15/25 11:00

Client ID: P6SB04_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	79		30-150	A
Decachlorobiphenyl	68		30-150	A
2,4,5,6-Tetrachloro-m-xylene	75		30-150	B
Decachlorobiphenyl	79		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565313
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-03
Client ID: P6SB04_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 11:00
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8151A
Analytical Date: 10/18/25 00:02
Analyst: JAG
Percent Solids: 83%
Methylation Date: 10/17/25 17:56

Extraction Method: EPA 8151A
Extraction Date: 10/16/25 19:06

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Chlorinated Herbicides by GC - Westborough Lab							
2,4-D	ND		ug/kg	199	12.5	1	A
2,4,5-T	ND		ug/kg	199	6.16	1	A
2,4,5-TP (Silvex)	ND		ug/kg	199	5.29	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
DCAA	79		30-150	A
DCAA	78		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565313
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-05
Client ID: P6SB10_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 12:20
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8081B
Analytical Date: 10/18/25 11:48
Analyst: PEG
Percent Solids: 89%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 09:17
Cleanup Method: EPA 3620B
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							
Delta-BHC	ND		ug/kg	1.79	0.350	1	A
Lindane	ND		ug/kg	0.744	0.333	1	A
Alpha-BHC	ND		ug/kg	0.744	0.211	1	A
Beta-BHC	ND		ug/kg	1.79	0.677	1	A
Heptachlor	ND		ug/kg	0.893	0.400	1	A
Aldrin	ND		ug/kg	1.79	0.629	1	A
Heptachlor epoxide	ND		ug/kg	3.35	1.00	1	A
Endrin	ND		ug/kg	0.744	0.305	1	A
Endrin aldehyde	ND		ug/kg	2.23	0.782	1	A
Endrin ketone	ND		ug/kg	1.79	0.460	1	A
Dieldrin	ND		ug/kg	1.12	0.558	1	A
4,4'-DDE	23.9		ug/kg	1.79	0.413	1	B
4,4'-DDD	ND		ug/kg	1.79	0.637	1	A
4,4'-DDT	14.7		ug/kg	1.79	1.44	1	B
Endosulfan I	ND		ug/kg	1.79	0.422	1	A
Endosulfan II	ND		ug/kg	1.79	0.597	1	A
Endosulfan sulfate	ND		ug/kg	0.744	0.354	1	A
Methoxychlor	ND		ug/kg	3.35	1.04	1	A
Toxaphene	ND		ug/kg	33.5	9.38	1	A
cis-Chlordane	ND	IP	ug/kg	2.23	0.622	1	B
trans-Chlordane	0.701	J	ug/kg	2.23	0.590	1	A
Chlordane	ND		ug/kg	14.9	5.92	1	A

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-05 Date Collected: 10/15/25 12:20

Client ID: P6SB10_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	77		30-150	A
Decachlorobiphenyl	75		30-150	A
2,4,5,6-Tetrachloro-m-xylene	76		30-150	B
Decachlorobiphenyl	85		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565313
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-05
Client ID: P6SB10_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 12:20
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8151A
Analytical Date: 10/18/25 00:21
Analyst: JAG
Percent Solids: 89%
Methylation Date: 10/17/25 17:56

Extraction Method: EPA 8151A
Extraction Date: 10/16/25 19:06

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Chlorinated Herbicides by GC - Westborough Lab							
2,4-D	ND		ug/kg	186	11.7	1	A
2,4,5-T	ND		ug/kg	186	5.77	1	A
2,4,5-TP (Silvex)	ND		ug/kg	186	4.95	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
DCAA	69		30-150	A
DCAA	74		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565313
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-07
Client ID: P6SB07_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 13:45
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8081B
Analytical Date: 10/18/25 11:59
Analyst: PEG
Percent Solids: 84%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 09:17
Cleanup Method: EPA 3620B
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							
Delta-BHC	ND		ug/kg	1.87	0.366	1	A
Lindane	ND		ug/kg	0.779	0.348	1	A
Alpha-BHC	ND		ug/kg	0.779	0.221	1	A
Beta-BHC	ND		ug/kg	1.87	0.709	1	A
Heptachlor	ND		ug/kg	0.934	0.419	1	A
Aldrin	ND		ug/kg	1.87	0.658	1	A
Heptachlor epoxide	ND		ug/kg	3.50	1.05	1	A
Endrin	ND		ug/kg	0.779	0.319	1	A
Endrin aldehyde	ND		ug/kg	2.34	0.818	1	A
Endrin ketone	ND		ug/kg	1.87	0.481	1	A
Dieldrin	ND		ug/kg	1.17	0.584	1	A
4,4'-DDE	13.2		ug/kg	1.87	0.432	1	A
4,4'-DDD	9.08	IP	ug/kg	1.87	0.667	1	A
4,4'-DDT	14.9		ug/kg	1.87	1.50	1	B
Endosulfan I	ND		ug/kg	1.87	0.442	1	A
Endosulfan II	ND		ug/kg	1.87	0.624	1	A
Endosulfan sulfate	ND		ug/kg	0.779	0.371	1	A
Methoxychlor	ND		ug/kg	3.50	1.09	1	A
Toxaphene	ND		ug/kg	35.0	9.81	1	A
cis-Chlordane	ND		ug/kg	2.34	0.651	1	A
trans-Chlordane	ND		ug/kg	2.34	0.617	1	A
Chlordane	ND		ug/kg	15.6	6.19	1	A

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-07 Date Collected: 10/15/25 13:45

Client ID: P6SB07_1-2 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	85		30-150	A
Decachlorobiphenyl	81		30-150	A
2,4,5,6-Tetrachloro-m-xylene	77		30-150	B
Decachlorobiphenyl	92		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565313
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-07
Client ID: P6SB07_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 13:45
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8151A
Analytical Date: 10/18/25 00:39
Analyst: JAG
Percent Solids: 84%
Methylation Date: 10/17/25 17:56

Extraction Method: EPA 8151A
Extraction Date: 10/16/25 19:06

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Chlorinated Herbicides by GC - Westborough Lab							
2,4-D	ND		ug/kg	197	12.4	1	A
2,4,5-T	ND		ug/kg	197	6.10	1	A
2,4,5-TP (Silvex)	ND		ug/kg	197	5.23	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
DCAA	32		30-150	A
DCAA	46		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565313
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-09
Client ID: P6SB06_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 14:30
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8081B
Analytical Date: 10/18/25 12:09
Analyst: PEG
Percent Solids: 82%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 09:17
Cleanup Method: EPA 3620B
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							
Delta-BHC	ND		ug/kg	1.90	0.372	1	A
Lindane	ND		ug/kg	0.790	0.353	1	A
Alpha-BHC	ND		ug/kg	0.790	0.224	1	A
Beta-BHC	ND		ug/kg	1.90	0.719	1	A
Heptachlor	ND		ug/kg	0.949	0.425	1	A
Aldrin	ND		ug/kg	1.90	0.668	1	A
Heptachlor epoxide	3.04	J	ug/kg	3.56	1.07	1	B
Endrin	ND		ug/kg	0.790	0.324	1	A
Endrin aldehyde	ND		ug/kg	2.37	0.830	1	A
Endrin ketone	ND		ug/kg	1.90	0.488	1	A
Dieldrin	ND		ug/kg	1.18	0.593	1	A
4,4'-DDE	10.6		ug/kg	1.90	0.439	1	B
4,4'-DDD	ND		ug/kg	1.90	0.677	1	A
4,4'-DDT	17.4		ug/kg	1.90	1.52	1	B
Endosulfan I	ND		ug/kg	1.90	0.448	1	A
Endosulfan II	ND		ug/kg	1.90	0.634	1	A
Endosulfan sulfate	ND		ug/kg	0.790	0.376	1	A
Methoxychlor	ND		ug/kg	3.56	1.11	1	A
Toxaphene	ND		ug/kg	35.6	9.96	1	A
cis-Chlordane	0.824	JIP	ug/kg	2.37	0.661	1	B
trans-Chlordane	1.37	J	ug/kg	2.37	0.626	1	B
Chlordane	ND		ug/kg	15.8	6.28	1	A

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-09 Date Collected: 10/15/25 14:30

Client ID: P6SB06_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	75		30-150	A
Decachlorobiphenyl	74		30-150	A
2,4,5,6-Tetrachloro-m-xylene	76		30-150	B
Decachlorobiphenyl	85		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565313
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-09
Client ID: P6SB06_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 14:30
Date Received: 10/15/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8151A
Analytical Date: 10/18/25 00:57
Analyst: JAG
Percent Solids: 82%
Methylation Date: 10/17/25 17:56

Extraction Method: EPA 8151A
Extraction Date: 10/16/25 19:06

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Chlorinated Herbicides by GC - Westborough Lab							
2,4-D	ND		ug/kg	198	12.5	1	A
2,4,5-T	ND		ug/kg	198	6.15	1	A
2,4,5-TP (Silvex)	ND		ug/kg	198	5.27	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
DCAA	68		30-150	A
DCAA	70		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8151A
Analytical Date: 10/17/25 18:37
Analyst: JAG

Extraction Method: EPA 8151A
Extraction Date: 10/16/25 15:57

Methylation Date: 10/17/25 10:30

Parameter	Result	Qualifier	Units	RL	MDL	Column
Chlorinated Herbicides by GC - Westborough Lab for sample(s): 01,03,05,07,09 Batch: WG2128845-1						
2,4-D	ND		ug/kg	162	10.2	A
2,4,5-T	ND		ug/kg	162	5.02	A
2,4,5-TP (Silvex)	ND		ug/kg	162	4.31	A

Surrogate	%Recovery	Qualifier	Acceptance Criteria	Column
DCAA	90		30-150	A
DCAA	107		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8081B
Analytical Date: 10/18/25 10:41
Analyst: PEG

Extraction Method: EPA 3546
Extraction Date: 10/17/25 09:17
Cleanup Method: EPA 3620B
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Column
Organochlorine Pesticides by GC - Westborough Lab for sample(s): 01,03,05,07,09 Batch: WG2129153-1						
Delta-BHC	ND		ug/kg	1.55	0.303	A
Lindane	ND		ug/kg	0.644	0.288	A
Alpha-BHC	ND		ug/kg	0.644	0.183	A
Beta-BHC	ND		ug/kg	1.55	0.586	A
Heptachlor	ND		ug/kg	0.773	0.347	A
Aldrin	ND		ug/kg	1.55	0.544	A
Heptachlor epoxide	ND		ug/kg	2.90	0.870	A
Endrin	ND		ug/kg	0.644	0.264	A
Endrin aldehyde	ND		ug/kg	1.93	0.676	A
Endrin ketone	ND		ug/kg	1.55	0.398	A
Dieldrin	ND		ug/kg	0.966	0.483	A
4,4'-DDE	ND		ug/kg	1.55	0.358	A
4,4'-DDD	ND		ug/kg	1.55	0.552	A
4,4'-DDT	ND		ug/kg	1.55	1.24	A
Endosulfan I	ND		ug/kg	1.55	0.365	A
Endosulfan II	ND		ug/kg	1.55	0.517	A
Endosulfan sulfate	ND		ug/kg	0.644	0.307	A
Methoxychlor	ND		ug/kg	2.90	0.902	A
Toxaphene	ND		ug/kg	29.0	8.12	A
cis-Chlordane	ND		ug/kg	1.93	0.539	A
trans-Chlordane	ND		ug/kg	1.93	0.510	A
Chlordane	ND		ug/kg	12.9	5.12	A

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8081B
Analytical Date: 10/18/25 10:41
Analyst: PEG

Extraction Method: EPA 3546
Extraction Date: 10/17/25 09:17
Cleanup Method: EPA 3620B
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Column
Organochlorine Pesticides by GC - Westborough Lab for sample(s): 01,03,05,07,09 Batch: WG2129153-1						

Surrogate	%Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	73		30-150	A
Decachlorobiphenyl	71		30-150	A
2,4,5,6-Tetrachloro-m-xylene	81		30-150	B
Decachlorobiphenyl	91		30-150	B

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits	Column
Chlorinated Herbicides by GC - Westborough Lab Associated sample(s): 01,03,05,07,09 Batch: WG2128845-2 WG2128845-3									
2,4-D	86		100		30-150	15		30	A
2,4,5-T	81		90		30-150	11		30	A
2,4,5-TP (Silvex)	84		97		30-150	14		30	A

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria	Column
DCAA	92		93		30-150	A
DCAA	99		103		30-150	B

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits	Column
Organochlorine Pesticides by GC - Westborough Lab Associated sample(s): 01,03,05,07,09 Batch: WG2129153-2 WG2129153-3									
Delta-BHC	85		85		30-150	0		30	A
Lindane	88		91		30-150	3		30	A
Alpha-BHC	89		90		30-150	1		30	A
Beta-BHC	93		94		30-150	1		30	A
Heptachlor	85		86		30-150	1		30	A
Aldrin	83		84		30-150	1		30	A
Heptachlor epoxide	86		81		30-150	6		30	A
Endrin	85		77		30-150	10		30	A
Endrin aldehyde	81		78		30-150	4		30	A
Endrin ketone	85		95		30-150	11		30	A
Dieldrin	83		85		30-150	2		30	A
4,4'-DDE	81		83		30-150	2		30	A
4,4'-DDD	85		86		30-150	1		30	A
4,4'-DDT	86		88		30-150	2		30	A
Endosulfan I	83		85		30-150	2		30	A
Endosulfan II	99		102		30-150	3		30	A
Endosulfan sulfate	80		83		30-150	4		30	A
Methoxychlor	96		99		30-150	3		30	A
cis-Chlordane	77		78		30-150	1		30	A

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits	
Organochlorine Pesticides by GC - Westborough Lab Associated sample(s): 01,03,05,07,09 Batch: WG2129153-2 WG2129153-3									
trans-Chlordane	91		78		30-150	15		30	A

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	74		75		30-150	A
Decachlorobiphenyl	68		79		30-150	A
2,4,5,6-Tetrachloro-m-xylene	80		80		30-150	B
Decachlorobiphenyl	92		93		30-150	B

METALS

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-01 Date Collected: 10/15/25 09:40

Client ID: P6SB03_1-2 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 85%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	7300		mg/kg	9.31	3.02	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.65	3.58	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Arsenic, Total	6.88		mg/kg	0.931	0.402	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Barium, Total	139		mg/kg	0.931	0.099	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.455	J	mg/kg	0.465	0.051	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.805	J	mg/kg	0.931	0.051	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Calcium, Total	55000		mg/kg	9.31	5.28	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Chromium, Total	13.4		mg/kg	0.931	0.789	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Cobalt, Total	7.54		mg/kg	1.86	0.231	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Copper, Total	56.1		mg/kg	0.931	0.211	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Iron, Total	14900		mg/kg	4.65	0.977	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Lead, Total	275		mg/kg	4.65	0.222	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Magnesium, Total	15900		mg/kg	9.31	1.52	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Manganese, Total	382		mg/kg	0.931	0.499	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Mercury, Total	1.01		mg/kg	0.094	0.061	1	10/20/25 12:07	10/21/25 11:18	EPA 7471B	1,7471B	JWN
Nickel, Total	21.2		mg/kg	2.33	0.752	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Potassium, Total	745		mg/kg	233	47.2	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Selenium, Total	0.317	J	mg/kg	1.86	0.306	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Silver, Total	0.387	J	mg/kg	0.465	0.277	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Sodium, Total	ND		mg/kg	186	98.6	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.86	0.840	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Vanadium, Total	18.4		mg/kg	0.931	0.140	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
Zinc, Total	202		mg/kg	4.65	0.564	2	10/20/25 10:39	10/21/25 21:46	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	13.4		mg/kg	0.941	0.789	1		10/21/25 21:46	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-02 Date Collected: 10/15/25 10:00

Client ID: P6SB03_4-5 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 88%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	10900		mg/kg	8.96	2.91	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.48	3.45	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Arsenic, Total	2.52		mg/kg	0.896	0.387	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Barium, Total	41.4		mg/kg	0.896	0.095	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.490		mg/kg	0.448	0.049	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Cadmium, Total	ND		mg/kg	0.896	0.049	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Calcium, Total	27800		mg/kg	8.96	5.08	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Chromium, Total	16.1		mg/kg	0.896	0.760	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Cobalt, Total	9.12		mg/kg	1.79	0.222	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Copper, Total	16.5		mg/kg	0.896	0.203	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Iron, Total	18200		mg/kg	4.48	0.940	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Lead, Total	13.6		mg/kg	4.48	0.213	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Magnesium, Total	17400		mg/kg	8.96	1.46	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Manganese, Total	251		mg/kg	0.896	0.480	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Mercury, Total	ND		mg/kg	0.073	0.048	1	10/20/25 12:07	10/21/25 11:28	EPA 7471B	1,7471B	JWN
Nickel, Total	24.8		mg/kg	2.24	0.724	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Potassium, Total	814		mg/kg	224	45.4	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	1.79	0.295	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.448	0.267	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Sodium, Total	ND		mg/kg	179	94.9	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.79	0.808	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Vanadium, Total	18.2		mg/kg	0.896	0.135	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
Zinc, Total	53.9		mg/kg	4.48	0.543	2	10/20/25 10:39	10/21/25 21:50	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	16.1		mg/kg	0.914	0.760	1		10/21/25 21:50	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-03 Date Collected: 10/15/25 11:00

Client ID: P6SB04_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 83%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	7540		mg/kg	9.17	2.98	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.59	3.53	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Arsenic, Total	6.19		mg/kg	0.917	0.396	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Barium, Total	241		mg/kg	0.917	0.097	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.520		mg/kg	0.459	0.050	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.609	J	mg/kg	0.917	0.050	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Calcium, Total	61400		mg/kg	9.17	5.20	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Chromium, Total	14.4		mg/kg	0.917	0.778	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Cobalt, Total	7.05		mg/kg	1.83	0.227	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Copper, Total	48.6		mg/kg	0.917	0.208	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Iron, Total	16400		mg/kg	4.59	0.963	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Lead, Total	153		mg/kg	4.59	0.218	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Magnesium, Total	14100		mg/kg	9.17	1.50	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Manganese, Total	488		mg/kg	0.917	0.492	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Mercury, Total	0.354		mg/kg	0.085	0.055	1	10/20/25 12:07	10/21/25 11:32	EPA 7471B	1,7471B	JWN
Nickel, Total	34.3		mg/kg	2.29	0.741	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Potassium, Total	823		mg/kg	229	46.5	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Selenium, Total	0.374	J	mg/kg	1.83	0.302	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Silver, Total	0.297	J	mg/kg	0.459	0.273	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Sodium, Total	ND		mg/kg	183	97.2	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.83	0.827	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Vanadium, Total	20.0		mg/kg	0.917	0.138	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
Zinc, Total	112		mg/kg	4.59	0.556	2	10/20/25 10:39	10/21/25 21:53	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	14.4		mg/kg	0.963	0.778	1		10/21/25 21:53	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-04 Date Collected: 10/15/25 11:40

Client ID: P6SB04_4-5 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 76%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	13300		mg/kg	10.2	3.32	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	5.11	3.93	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Arsenic, Total	4.08		mg/kg	1.02	0.441	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Barium, Total	132		mg/kg	1.02	0.108	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.646		mg/kg	0.511	0.056	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.194	J	mg/kg	1.02	0.056	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Calcium, Total	29100		mg/kg	10.2	5.79	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Chromium, Total	19.2		mg/kg	1.02	0.866	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Cobalt, Total	9.30		mg/kg	2.04	0.253	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Copper, Total	28.2		mg/kg	1.02	0.232	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Iron, Total	19800		mg/kg	5.11	1.07	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Lead, Total	130		mg/kg	5.11	0.243	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Magnesium, Total	12500		mg/kg	10.2	1.66	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Manganese, Total	460		mg/kg	1.02	0.547	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Mercury, Total	0.311		mg/kg	0.103	0.067	1	10/20/25 12:07	10/21/25 11:35	EPA 7471B	1,7471B	JWN
Nickel, Total	29.2		mg/kg	2.55	0.825	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Potassium, Total	962		mg/kg	255	51.8	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	2.04	0.336	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.511	0.304	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Sodium, Total	ND		mg/kg	204	108.	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	2.04	0.921	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Vanadium, Total	19.9		mg/kg	1.02	0.154	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
Zinc, Total	95.4		mg/kg	5.11	0.619	2	10/20/25 10:39	10/21/25 22:30	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	19.2		mg/kg	1.06	0.866	1		10/21/25 22:30	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-05 Date Collected: 10/15/25 12:20

Client ID: P6SB10_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 89%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	8590		mg/kg	8.54	2.78	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.27	3.29	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Arsenic, Total	5.68		mg/kg	0.854	0.369	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Barium, Total	146		mg/kg	0.854	0.091	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.526		mg/kg	0.427	0.047	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.481	J	mg/kg	0.854	0.047	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Calcium, Total	50800		mg/kg	8.54	4.84	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Chromium, Total	14.2		mg/kg	0.854	0.724	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Cobalt, Total	7.40		mg/kg	1.71	0.212	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Copper, Total	51.9		mg/kg	0.854	0.194	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Iron, Total	16200		mg/kg	4.27	0.897	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Lead, Total	290		mg/kg	4.27	0.203	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Magnesium, Total	12700		mg/kg	8.54	1.39	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Manganese, Total	451		mg/kg	0.854	0.458	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Mercury, Total	0.293		mg/kg	0.077	0.050	1	10/20/25 12:07	10/21/25 11:38	EPA 7471B	1,7471B	JWN
Nickel, Total	22.1		mg/kg	2.14	0.690	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Potassium, Total	910		mg/kg	214	43.3	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	1.71	0.281	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.427	0.255	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Sodium, Total	ND		mg/kg	171	90.6	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.71	0.771	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Vanadium, Total	18.8		mg/kg	0.854	0.129	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
Zinc, Total	136		mg/kg	4.27	0.518	2	10/20/25 10:39	10/21/25 22:33	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	14.2		mg/kg	0.903	0.724	1		10/21/25 22:33	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-06 Date Collected: 10/15/25 12:45

Client ID: P6SB10_2-3 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 87%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	13100		mg/kg	9.02	2.93	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.51	3.47	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Arsenic, Total	3.02		mg/kg	0.902	0.389	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Barium, Total	51.9		mg/kg	0.902	0.096	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.599		mg/kg	0.451	0.050	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Cadmium, Total	ND		mg/kg	0.902	0.050	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Calcium, Total	11400		mg/kg	9.02	5.11	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Chromium, Total	19.3		mg/kg	0.902	0.764	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Cobalt, Total	10.6		mg/kg	1.80	0.224	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Copper, Total	17.8		mg/kg	0.902	0.205	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Iron, Total	21900		mg/kg	4.51	0.946	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Lead, Total	20.4		mg/kg	4.51	0.214	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Magnesium, Total	10000		mg/kg	9.02	1.47	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Manganese, Total	310		mg/kg	0.902	0.483	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Mercury, Total	0.051	J	mg/kg	0.076	0.050	1	10/20/25 12:07	10/21/25 11:42	EPA 7471B	1,7471B	JWN
Nickel, Total	28.3		mg/kg	2.25	0.728	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Potassium, Total	810		mg/kg	225	45.7	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	1.80	0.296	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.451	0.269	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Sodium, Total	209		mg/kg	180	95.6	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.80	0.813	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Vanadium, Total	21.9		mg/kg	0.902	0.136	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
Zinc, Total	57.8		mg/kg	4.51	0.546	2	10/20/25 10:39	10/21/25 22:37	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	19.3		mg/kg	0.920	0.764	1		10/21/25 22:37	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-07 Date Collected: 10/15/25 13:45

Client ID: P6SB07_1-2 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 84%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	6400		mg/kg	9.33	3.03	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.66	3.59	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Arsenic, Total	6.64		mg/kg	0.933	0.403	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Barium, Total	208		mg/kg	0.933	0.099	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.419	J	mg/kg	0.466	0.051	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.356	J	mg/kg	0.933	0.051	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Calcium, Total	38100		mg/kg	9.33	5.29	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Chromium, Total	11.4		mg/kg	0.933	0.791	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Cobalt, Total	5.86		mg/kg	1.87	0.231	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Copper, Total	59.1		mg/kg	0.933	0.212	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Iron, Total	11400		mg/kg	4.66	0.980	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Lead, Total	417		mg/kg	4.66	0.222	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Magnesium, Total	8940		mg/kg	9.33	1.52	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Manganese, Total	272		mg/kg	0.933	0.500	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Mercury, Total	0.500		mg/kg	0.090	0.059	1	10/20/25 12:07	10/21/25 11:45	EPA 7471B	1,7471B	JWN
Nickel, Total	15.0		mg/kg	2.33	0.754	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Potassium, Total	820		mg/kg	233	47.3	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	1.87	0.307	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.466	0.278	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Sodium, Total	142	J	mg/kg	187	98.9	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.87	0.842	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Vanadium, Total	18.2		mg/kg	0.933	0.141	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
Zinc, Total	145		mg/kg	4.66	0.565	2	10/20/25 10:39	10/21/25 22:40	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	11.4		mg/kg	0.957	0.791	1		10/21/25 22:40	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-08 Date Collected: 10/15/25 14:15

Client ID: P6SB07_2-3 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 84%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	6710		mg/kg	9.12	2.96	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.56	3.51	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Arsenic, Total	6.41		mg/kg	0.912	0.394	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Barium, Total	166		mg/kg	0.912	0.097	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.405	J	mg/kg	0.456	0.050	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.266	J	mg/kg	0.912	0.050	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Calcium, Total	45700		mg/kg	9.12	5.17	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Chromium, Total	11.1		mg/kg	0.912	0.774	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Cobalt, Total	6.51		mg/kg	1.82	0.226	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Copper, Total	51.5		mg/kg	0.912	0.207	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Iron, Total	13200		mg/kg	4.56	0.958	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Lead, Total	194		mg/kg	4.56	0.217	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Magnesium, Total	12400		mg/kg	9.12	1.49	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Manganese, Total	324		mg/kg	0.912	0.489	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Mercury, Total	0.477		mg/kg	0.083	0.054	1	10/20/25 12:07	10/21/25 11:48	EPA 7471B	1,7471B	JWN
Nickel, Total	15.8		mg/kg	2.28	0.737	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Potassium, Total	836		mg/kg	228	46.2	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	1.82	0.300	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Silver, Total	0.272	J	mg/kg	0.456	0.272	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Sodium, Total	113	J	mg/kg	182	96.7	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.82	0.823	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Vanadium, Total	18.4		mg/kg	0.912	0.138	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
Zinc, Total	117		mg/kg	4.56	0.553	2	10/20/25 10:39	10/21/25 22:44	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	11.1		mg/kg	0.952	0.774	1		10/21/25 22:44	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-09 Date Collected: 10/15/25 14:30

Client ID: P6SB06_0-1 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 82%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	8250		mg/kg	9.48	3.08	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.74	3.65	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Arsenic, Total	6.16		mg/kg	0.948	0.409	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Barium, Total	194		mg/kg	0.948	0.100	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.500		mg/kg	0.474	0.052	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.584	J	mg/kg	0.948	0.052	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Calcium, Total	51200		mg/kg	9.48	5.37	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Chromium, Total	15.3		mg/kg	0.948	0.804	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Cobalt, Total	7.62		mg/kg	1.90	0.235	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Copper, Total	49.9		mg/kg	0.948	0.215	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Iron, Total	16800		mg/kg	4.74	0.995	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Lead, Total	230		mg/kg	4.74	0.226	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Magnesium, Total	15600		mg/kg	9.48	1.54	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Manganese, Total	390		mg/kg	0.948	0.508	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Mercury, Total	0.559		mg/kg	0.090	0.059	1	10/20/25 12:07	10/21/25 11:51	EPA 7471B	1,7471B	JWN
Nickel, Total	21.0		mg/kg	2.37	0.766	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Potassium, Total	1010		mg/kg	237	48.0	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Selenium, Total	0.362	J	mg/kg	1.90	0.312	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Silver, Total	0.652		mg/kg	0.474	0.282	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Sodium, Total	ND		mg/kg	190	100.	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.90	0.855	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Vanadium, Total	19.9		mg/kg	0.948	0.143	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
Zinc, Total	168		mg/kg	4.74	0.574	2	10/20/25 10:39	10/21/25 22:47	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	15.3		mg/kg	0.972	0.804	1		10/21/25 22:47	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-10 Date Collected: 10/15/25 14:50

Client ID: P6SB06_3-4 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 85%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	9160		mg/kg	8.94	2.91	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Antimony, Total	ND		mg/kg	4.47	3.44	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Arsenic, Total	8.14		mg/kg	0.894	0.386	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Barium, Total	105		mg/kg	0.894	0.095	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Beryllium, Total	0.456		mg/kg	0.447	0.049	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Cadmium, Total	ND		mg/kg	0.894	0.049	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Calcium, Total	53400		mg/kg	8.94	5.07	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Chromium, Total	14.8		mg/kg	0.894	0.758	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Cobalt, Total	9.63		mg/kg	1.79	0.222	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Copper, Total	55.3		mg/kg	0.894	0.203	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Iron, Total	17900		mg/kg	4.47	0.939	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Lead, Total	183		mg/kg	4.47	0.213	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Magnesium, Total	15400		mg/kg	8.94	1.46	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Manganese, Total	542		mg/kg	0.894	0.479	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Mercury, Total	0.610		mg/kg	0.086	0.056	1	10/21/25 03:30	10/21/25 17:39	EPA 7471B	1,7471B	JWN
Nickel, Total	24.7		mg/kg	2.24	0.722	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Potassium, Total	964		mg/kg	224	45.3	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Selenium, Total	ND		mg/kg	1.79	0.294	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Silver, Total	ND		mg/kg	0.447	0.266	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Sodium, Total	105	J	mg/kg	179	94.8	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Thallium, Total	ND		mg/kg	1.79	0.806	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Vanadium, Total	20.8		mg/kg	0.894	0.135	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
Zinc, Total	94.6		mg/kg	4.47	0.542	2	10/21/25 00:35	10/22/25 13:14	EPA 3050B	1,6010D	DHL
General Chemistry - Mansfield Lab											
Chromium, Trivalent	14.8		mg/kg	0.938	0.758	1		10/22/25 13:14	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Total Metals - Mansfield Lab for sample(s): 01-09 Batch: WG2130017-1										
Aluminum, Total	ND		mg/kg	4.00	1.30	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Antimony, Total	ND		mg/kg	2.00	1.54	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Arsenic, Total	ND		mg/kg	0.400	0.173	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Barium, Total	ND		mg/kg	0.400	0.042	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Beryllium, Total	ND		mg/kg	0.200	0.022	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Cadmium, Total	ND		mg/kg	0.400	0.022	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Calcium, Total	ND		mg/kg	4.00	2.27	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Chromium, Total	ND		mg/kg	0.400	0.339	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Cobalt, Total	ND		mg/kg	0.800	0.099	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Copper, Total	ND		mg/kg	0.400	0.091	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Iron, Total	0.824	J	mg/kg	2.00	0.420	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Lead, Total	ND		mg/kg	2.00	0.095	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Magnesium, Total	ND		mg/kg	4.00	0.652	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Manganese, Total	ND		mg/kg	0.400	0.214	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Nickel, Total	ND		mg/kg	1.00	0.323	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Potassium, Total	ND		mg/kg	100	20.3	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Selenium, Total	ND		mg/kg	0.800	0.132	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.200	0.119	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Sodium, Total	ND		mg/kg	80.0	42.4	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Thallium, Total	ND		mg/kg	0.800	0.361	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Vanadium, Total	ND		mg/kg	0.400	0.060	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC
Zinc, Total	ND		mg/kg	2.00	0.242	1	10/20/25 10:39	10/21/25 20:37	1,6010D	ZPC

Prep Information

Digestion Method: EPA 3050B

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Total Metals - Mansfield Lab for sample(s): 01-09 Batch: WG2130022-1										
Mercury, Total	ND		mg/kg	0.083	0.054	1	10/20/25 12:07	10/21/25 10:22	1,7471B	JWN

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Prep Information

Digestion Method: EPA 7471B

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Total Metals - Mansfield Lab for sample(s): 10 Batch: WG2130330-1										
Aluminum, Total	ND		mg/kg	4.00	1.30	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Antimony, Total	ND		mg/kg	2.00	1.54	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Arsenic, Total	ND		mg/kg	0.400	0.173	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Barium, Total	ND		mg/kg	0.400	0.042	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Beryllium, Total	ND		mg/kg	0.200	0.022	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Cadmium, Total	ND		mg/kg	0.400	0.022	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Calcium, Total	ND		mg/kg	4.00	2.27	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Chromium, Total	ND		mg/kg	0.400	0.339	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Cobalt, Total	ND		mg/kg	0.800	0.099	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Copper, Total	ND		mg/kg	0.400	0.091	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Iron, Total	3.06		mg/kg	2.00	0.420	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Lead, Total	ND		mg/kg	2.00	0.095	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Magnesium, Total	ND		mg/kg	4.00	0.652	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Manganese, Total	ND		mg/kg	0.400	0.214	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Nickel, Total	ND		mg/kg	1.00	0.323	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Potassium, Total	ND		mg/kg	100	20.3	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Selenium, Total	ND		mg/kg	0.800	0.132	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Silver, Total	ND		mg/kg	0.200	0.119	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Sodium, Total	ND		mg/kg	80.0	42.4	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Thallium, Total	ND		mg/kg	0.800	0.361	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Vanadium, Total	ND		mg/kg	0.400	0.060	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL
Zinc, Total	ND		mg/kg	2.00	0.242	1	10/21/25 00:35	10/22/25 13:02	1,6010D	DHL

Prep Information

Digestion Method: EPA 3050B

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Total Metals - Mansfield Lab for sample(s): 10 Batch: WG2130333-1										
Mercury, Total	ND		mg/kg	0.083	0.054	1	10/21/25 03:30	10/21/25 16:13	1,7471B	JWN

Prep Information

Digestion Method: EPA 7471B

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-09 Batch: WG2130017-2								
Aluminum, Total	102		-		80-120	-		20
Antimony, Total	99		-		80-120	-		20
Arsenic, Total	96		-		80-120	-		20
Barium, Total	99		-		80-120	-		20
Beryllium, Total	102		-		80-120	-		20
Cadmium, Total	98		-		80-120	-		20
Calcium, Total	101		-		80-120	-		20
Chromium, Total	98		-		80-120	-		20
Cobalt, Total	98		-		80-120	-		20
Copper, Total	100		-		80-120	-		20
Iron, Total	102		-		80-120	-		20
Lead, Total	98		-		80-120	-		20
Magnesium, Total	98		-		80-120	-		20
Manganese, Total	100		-		80-120	-		20
Nickel, Total	99		-		80-120	-		20
Potassium, Total	103		-		80-120	-		20
Selenium, Total	99		-		80-120	-		20
Silver, Total	98		-		80-120	-		20
Sodium, Total	103		-		80-120	-		20
Thallium, Total	98		-		80-120	-		20
Vanadium, Total	101		-		80-120	-		20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	LCSD %Recovery	%Recovery Limits	RPD	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-09 Batch: WG2130017-2					
Zinc, Total	98	-	80-120	-	20
Total Metals - Mansfield Lab Associated sample(s): 01-09 Batch: WG2130022-2					
Mercury, Total	94	-	80-120	-	20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	LCSD %Recovery	%Recovery Limits	RPD	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 10 Batch: WG2130330-2					
Aluminum, Total	114	-	80-120	-	20
Antimony, Total	100	-	80-120	-	20
Arsenic, Total	102	-	80-120	-	20
Barium, Total	111	-	80-120	-	20
Beryllium, Total	114	-	80-120	-	20
Cadmium, Total	101	-	80-120	-	20
Calcium, Total	110	-	80-120	-	20
Chromium, Total	108	-	80-120	-	20
Cobalt, Total	99	-	80-120	-	20
Copper, Total	109	-	80-120	-	20
Iron, Total	114	-	80-120	-	20
Lead, Total	102	-	80-120	-	20
Magnesium, Total	105	-	80-120	-	20
Manganese, Total	113	-	80-120	-	20
Nickel, Total	100	-	80-120	-	20
Potassium, Total	114	-	80-120	-	20
Selenium, Total	100	-	80-120	-	20
Silver, Total	108	-	80-120	-	20
Sodium, Total	112	-	80-120	-	20
Thallium, Total	103	-	80-120	-	20
Vanadium, Total	111	-	80-120	-	20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	LCSD %Recovery	%Recovery Limits	RPD	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 10 Batch: WG2130330-2					
Zinc, Total	100	-	80-120	-	20
Total Metals - Mansfield Lab Associated sample(s): 10 Batch: WG2130333-2					
Mercury, Total	101	-	80-120	-	20

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-09 QC Batch ID: WG2130017-3 QC Sample: L2565227-04 Client ID: MS Sample												
Aluminum, Total	7350	174	7970	**357**	Q	-	-		75-125	-		
Antimony, Total	ND	43.4	15.1	**35**	Q	-	-		75-125	-		
Arsenic, Total	1.70	10.4	9.88	78		-	-		75-125	-		
Barium, Total	35.5	174	202	96		-	-		75-125	-		
Beryllium, Total	0.289J	4.34	4.42	102		-	-		75-125	-		
Cadmium, Total	0.289J	4.6	4.32	94		-	-		75-125	-		
Calcium, Total	7560	868	10900	**385**	Q	-	-		75-125	-		
Chromium, Total	20.2	17.4	27.9	**44**	Q	-	-		75-125	-		
Cobalt, Total	6.41	43.4	44.4	88		-	-		75-125	-		
Copper, Total	34.2	21.7	54.8	95		-	-		75-125	-		
Iron, Total	12600	86.8	12800	**230**	Q	-	-		75-125	-		
Lead, Total	40.8	46	97.2	122		-	-		75-125	-		
Magnesium, Total	4210	868	6570	**272**	Q	-	-		75-125	-		
Manganese, Total	290	43.4	354	**147**	Q	-	-		75-125	-		
Nickel, Total	14.5	43.4	52.2	87		-	-		75-125	-		
Potassium, Total	752	868	1540	91		-	-		75-125	-		
Selenium, Total	ND	10.4	6.71	**64**	Q	-	-		75-125	-		
Silver, Total	ND	4.34	4.23	97		-	-		75-125	-		
Sodium, Total	765	868	1470	81		-	-		75-125	-		

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-09 QC Batch ID: WG2130017-3 QC Sample: L2565227-04 Client ID: MS Sample												
Thallium, Total	ND	10.4	9.93	95		-	-		75-125	-		
Vanadium, Total	25.8	43.4	63.0	86		-	-		75-125	-		
Zinc, Total	55.7	43.4	99.7	101		-	-		75-125	-		
Total Metals - Mansfield Lab Associated sample(s): 01-09 QC Batch ID: WG2130022-3 QC Sample: L2565227-04 Client ID: MS Sample												
Mercury, Total	0.124	1.52	1.58	96		-	-		80-120	-		

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 10 QC Batch ID: WG2130330-3 QC Sample: L2564679-01 Client ID: MS Sample												
Aluminum, Total	6080	164	6710	**385**	Q	-	-		75-125	-		
Antimony, Total	ND	40.9	20.5	**50**	Q	-	-		75-125	-		
Arsenic, Total	2.82	9.82	12.1	94		-	-		75-125	-		
Barium, Total	31.0	164	213	111		-	-		75-125	-		
Beryllium, Total	0.169J	4.09	4.44	108		-	-		75-125	-		
Cadmium, Total	ND	4.34	4.36	100		-	-		75-125	-		
Calcium, Total	4300	818	4420	**15**	Q	-	-		75-125	-		
Chromium, Total	12.3	16.4	46.9	**211**	Q	-	-		75-125	-		
Cobalt, Total	4.85	40.9	46.1	101		-	-		75-125	-		
Copper, Total	20.1	20.5	38.8	91		-	-		75-125	-		
Iron, Total	10800	81.8	10200	**0**	Q	-	-		75-125	-		
Lead, Total	16.3	43.4	59.1	99		-	-		75-125	-		
Magnesium, Total	2860	818	3420	**68**	Q	-	-		75-125	-		
Manganese, Total	192	40.9	394	**494**	Q	-	-		75-125	-		
Nickel, Total	14.9	40.9	58.1	106		-	-		75-125	-		
Potassium, Total	509	818	1400	109		-	-		75-125	-		
Selenium, Total	ND	9.82	9.08	92		-	-		75-125	-		
Silver, Total	ND	4.09	4.13	101		-	-		75-125	-		
Sodium, Total	134J	818	974	119		-	-		75-125	-		

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 10 QC Batch ID: WG2130330-3 QC Sample: L2564679-01 Client ID: MS Sample												
Thallium, Total	ND	9.82	9.24	94		-	-		75-125	-		
Vanadium, Total	16.9	40.9	59.0	103		-	-		75-125	-		
Zinc, Total	36.8	40.9	106	**169**	Q	-	-		75-125	-		
Total Metals - Mansfield Lab Associated sample(s): 10 QC Batch ID: WG2130333-3 QC Sample: L2564679-01 Client ID: MS Sample												
Mercury, Total	ND	1.7	1.67	98		-	-		80-120	-		

Lab Duplicate Analysis

Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565313
Report Date: 10/30/25

Parameter	Native Sample	Duplicate Sample	Units	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-09 QC Batch ID: WG2130017-4 QC Sample: L2565227-04 Client ID: DUP Sample						
Aluminum, Total	7350	6850	mg/kg	7		20
Antimony, Total	ND	ND	mg/kg	NC		20
Arsenic, Total	1.70	2.65	mg/kg	**44**	Q	20
Barium, Total	35.5	42.8	mg/kg	19		20
Beryllium, Total	0.289J	0.315J	mg/kg	NC		20
Cadmium, Total	0.289J	0.208J	mg/kg	NC		20
Calcium, Total	7560	3730	mg/kg	**68**	Q	20
Chromium, Total	20.2	12.9	mg/kg	**44**	Q	20
Cobalt, Total	6.41	5.60	mg/kg	13		20
Copper, Total	34.2	30.6	mg/kg	11		20
Iron, Total	12600	12700	mg/kg	1		20
Lead, Total	40.8	72.1	mg/kg	**55**	Q	20
Magnesium, Total	4210	3280	mg/kg	**25**	Q	20
Manganese, Total	290	307	mg/kg	6		20
Nickel, Total	14.5	12.4	mg/kg	16		20
Potassium, Total	752	551	mg/kg	**31**	Q	20
Selenium, Total	ND	ND	mg/kg	NC		20

Lab Duplicate Analysis

Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI

Project Number: 170859701

Lab Number: L2565313

Report Date: 10/30/25

Parameter	Native Sample	Duplicate Sample	Units	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-09 QC Batch ID: WG2130017-4 QC Sample: L2565227-04 Client ID: DUP Sample						
Silver, Total	ND	ND	mg/kg	NC		20
Sodium, Total	765	701	mg/kg	9		20
Thallium, Total	ND	ND	mg/kg	NC		20
Vanadium, Total	25.8	19.6	mg/kg	**27**	Q	20
Zinc, Total	55.7	77.4	mg/kg	**33**	Q	20
Total Metals - Mansfield Lab Associated sample(s): 01-09 QC Batch ID: WG2130022-4 QC Sample: L2565227-04 Client ID: DUP Sample						
Mercury, Total	0.124	0.106	mg/kg	16		20

Lab Duplicate Analysis

Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565313
Report Date: 10/30/25

Parameter	Native Sample	Duplicate Sample	Units	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 10 QC Batch ID: WG2130330-4 QC Sample: L2564679-01 Client ID: DUP Sample						
Aluminum, Total	6080	6100	mg/kg	0		20
Antimony, Total	ND	ND	mg/kg	NC		20
Arsenic, Total	2.82	2.19	mg/kg	**25**	Q	20
Barium, Total	31.0	28.3	mg/kg	9		20
Beryllium, Total	0.169J	0.166J	mg/kg	NC		20
Cadmium, Total	ND	ND	mg/kg	NC		20
Calcium, Total	4300	10000	mg/kg	**80**	Q	20
Chromium, Total	12.3	12.3	mg/kg	0		20
Cobalt, Total	4.85	4.75	mg/kg	2		20
Copper, Total	20.1	15.4	mg/kg	**26**	Q	20
Iron, Total	10800	9500	mg/kg	13		20
Lead, Total	16.3	13.7	mg/kg	17		20
Magnesium, Total	2860	6080	mg/kg	**72**	Q	20
Manganese, Total	192	189	mg/kg	2		20
Nickel, Total	14.9	14.7	mg/kg	1		20
Potassium, Total	509	543	mg/kg	6		20
Selenium, Total	ND	ND	mg/kg	NC		20

Lab Duplicate Analysis

Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI

Project Number: 170859701

Lab Number: L2565313

Report Date: 10/30/25

Parameter	Native Sample	Duplicate Sample	Units	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 10 QC Batch ID: WG2130330-4 QC Sample: L2564679-01 Client ID: DUP Sample						
Silver, Total	ND	ND	mg/kg	NC		20
Sodium, Total	134J	90.2J	mg/kg	NC		20
Thallium, Total	ND	ND	mg/kg	NC		20
Vanadium, Total	16.9	16.3	mg/kg	4		20
Zinc, Total	36.8	40.9	mg/kg	11		20
Total Metals - Mansfield Lab Associated sample(s): 10 QC Batch ID: WG2130333-4 QC Sample: L2564679-01 Client ID: DUP Sample						
Mercury, Total	ND	ND	mg/kg	NC		20

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Serial Dilution Analysis
Batch Quality Control

Lab Number: L2565313
Report Date: 10/30/25

Parameter	Native Sample	Serial Dilution	Units	% D	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-09 QC Batch ID: WG2130017-6 QC Sample: L2565227-04 Client ID: DUP Sample						
Aluminum, Total	7350	7680	mg/kg	4		20
Barium, Total	35.5	37.1	mg/kg	5		20
Calcium, Total	7560	8080	mg/kg	7		20
Copper, Total	34.2	34.9	mg/kg	2		20
Iron, Total	12600	13900	mg/kg	10		20
Magnesium, Total	4210	4520	mg/kg	7		20
Manganese, Total	290	313	mg/kg	8		20
Vanadium, Total	25.8	26.6	mg/kg	3		20

INORGANICS
&
MISCELLANEOUS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-01
Client ID: P6SB03_1-2
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/15/25 09:40
Date Received: 10/15/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	85.0		%	0.100	NA	1	-	10/16/25 13:03	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.1	0.23	1	10/21/25 11:00	10/21/25 16:05	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.941	0.188	1	10/16/25 11:47	10/17/25 09:30	1,7196A	RDS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-02
Client ID: P6SB03_4-5
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil

Date Collected: 10/15/25 10:00
Date Received: 10/15/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	87.5		%	0.100	NA	1	-	10/16/25 13:03	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.1	0.23	1	10/21/25 11:00	10/21/25 16:06	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.914	0.183	1	10/16/25 11:47	10/17/25 09:30	1,7196A	RDS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-03
Client ID: P6SB04_0-1
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/15/25 11:00
Date Received: 10/15/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	83.1		%	0.100	NA	1	-	10/16/25 13:03	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.2	0.24	1	10/21/25 11:00	10/21/25 16:07	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.963	0.192	1	10/16/25 11:47	10/17/25 09:30	1,7196A	RDS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-04
Client ID: P6SB04_4-5
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/15/25 11:40
Date Received: 10/15/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	75.5		%	0.100	NA	1	-	10/16/25 13:03	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.3	0.27	1	10/21/25 11:00	10/21/25 16:08	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	1.06	0.212	1	10/16/25 11:47	10/17/25 09:30	1,7196A	RDS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-05
Client ID: P6SB10_0-1
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/15/25 12:20
Date Received: 10/15/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	88.6		%	0.100	NA	1	-	10/16/25 13:03	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.0	0.22	1	10/21/25 11:00	10/21/25 16:09	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.903	0.180	1	10/16/25 11:47	10/17/25 09:30	1,7196A	RDS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-06
Client ID: P6SB10_2-3
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/15/25 12:45
Date Received: 10/15/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	87.0		%	0.100	NA	1	-	10/16/25 13:03	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.1	0.24	1	10/21/25 11:00	10/21/25 16:12	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.920	0.184	1	10/16/25 11:47	10/17/25 09:30	1,7196A	RDS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-07
Client ID: P6SB07_1-2
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/15/25 13:45
Date Received: 10/15/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	83.6		%	0.100	NA	1	-	10/16/25 13:03	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.2	0.24	1	10/21/25 11:00	10/21/25 16:13	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.957	0.191	1	10/16/25 11:47	10/17/25 09:30	1,7196A	RDS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-08
Client ID: P6SB07_2-3
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/15/25 14:15
Date Received: 10/15/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	84.0		%	0.100	NA	1	-	10/16/25 13:03	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.1	0.23	1	10/21/25 11:00	10/21/25 16:14	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.952	0.190	1	10/16/25 11:47	10/17/25 09:30	1,7196A	RDS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-09
Client ID: P6SB06_0-1
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/15/25 14:30
Date Received: 10/15/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	82.3		%	0.100	NA	1	-	10/16/25 13:03	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.1	0.24	1	10/21/25 11:00	10/21/25 16:15	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.972	0.194	1	10/16/25 11:47	10/17/25 09:30	1,7196A	RDS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565313-10
Client ID: P6SB06_3-4
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/15/25 14:50
Date Received: 10/15/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	85.3		%	0.100	NA	1	-	10/16/25 13:03	121,2540G	ROI
Cyanide, Total	0.31	J	mg/kg	1.1	0.23	1	10/21/25 11:00	10/21/25 16:16	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.938	0.188	1	10/16/25 11:47	10/17/25 09:30	1,7196A	RDS

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab for sample(s): 01-10 Batch: WG2128644-1										
Chromium, Hexavalent	ND		mg/kg	0.800	0.160	1	10/16/25 11:47	10/17/25 09:30	1,7196A	RDS
General Chemistry - Westborough Lab for sample(s): 01-10 Batch: WG2130558-1										
Cyanide, Total	ND		mg/kg	0.96	0.20	1	10/21/25 11:00	10/21/25 16:01	1,9010C/9012B	JER

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565313
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
General Chemistry - Westborough Lab Associated sample(s): 01-10 Batch: WG2128644-2								
Chromium, Hexavalent	**76**	Q	-		80-120	-		
General Chemistry - Westborough Lab Associated sample(s): 01-10 Batch: WG2130558-2 WG2130558-3								
Cyanide, Total	**78**	Q	**78**	Q	80-120	0		35

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565313
Report Date: 10/30/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
General Chemistry - Westborough Lab Associated sample(s): 01-10 QC Batch ID: WG2128644-4 QC Sample: L2565313-01 Client ID: P6SB03_1-2												
Chromium, Hexavalent	ND	1520	1290	85		-	-		75-125	-		
General Chemistry - Westborough Lab Associated sample(s): 01-10 QC Batch ID: WG2130558-4 WG2130558-5 QC Sample: L2565319-07 Client ID: MS Sample												
Cyanide, Total	ND	10	9.2	92		8.7	87		75-125	6		35
General Chemistry - Westborough Lab Associated sample(s): 01-10 QC Batch ID: WG2130558-6 WG2130558-7 QC Sample: L2565319-08 Client ID: MS Sample												
Cyanide, Total	ND	12	10	83		11	92		75-125	10		35

Lab Duplicate Analysis

Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI

Project Number: 170859701

Lab Number: L2565313

Report Date: 10/30/25

Parameter	Native Sample	Duplicate Sample	Units	RPD	Qual	RPD Limits
General Chemistry - Westborough Lab Associated sample(s): 01-10 QC Batch ID: WG2128619-1 QC Sample: L2565313-01 Client ID: P6SB03_1-2						
Solids, Total	85.0	85.2	%	0		10
General Chemistry - Westborough Lab Associated sample(s): 01-10 QC Batch ID: WG2128644-6 QC Sample: L2565313-01 Client ID: P6SB03_1-2						
Chromium, Hexavalent	ND	ND	mg/kg	NC		20

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565313
Report Date: 10/30/25

Sample Receipt and Container Information

Were project specific reporting limits specified? YES

Cooler Information

Cooler	Custody Seal
A	Absent
B	Absent

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565313-01A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565313-01B	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:49	NYTCL-8260HLW(14)
L2565313-01C	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:49	NYTCL-8260HLW(14)
L2565313-01D	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565313-01E	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),AS-TI(180),BA-TI(180),AG-TI(180),CR-TI(180),AL-TI(180),TL-TI(180),NI-TI(180),CU-TI(180),SB-TI(180),PB-TI(180),ZN-TI(180),SE-TI(180),V-TI(180),CO-TI(180),FE-TI(180),MN-TI(180),HG-T(28),MG-TI(180),CD-TI(180),K-TI(180),NA-TI(180),CA-TI(180)
L2565313-01F	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-01G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-02A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565313-02B	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:49	NYTCL-8260HLW(14)
L2565313-02C	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:49	NYTCL-8260HLW(14)
L2565313-02D	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565313-02E	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),BA-TI(180),AS-TI(180),AG-TI(180),TL-TI(180),CR-TI(180),NI-TI(180),AL-TI(180),CU-TI(180),ZN-TI(180),PB-TI(180),SE-TI(180),SB-TI(180),V-TI(180),CO-TI(180),HG-T(28),FE-TI(180),MG-TI(180),MN-TI(180),K-TI(180),NA-TI(180),CD-TI(180),CA-TI(180)

*Values in parentheses indicate holding time in days

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565313
Report Date: 10/30/25

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565313-02F	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-02G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-03A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565313-03B	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:49	NYTCL-8260HLW(14)
L2565313-03C	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:49	NYTCL-8260HLW(14)
L2565313-03D	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565313-03E	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),BA-TI(180),AS-TI(180),AG-TI(180),NI-TI(180),AL-TI(180),CR-TI(180),TL-TI(180),SB-TI(180),SE-TI(180),ZN-TI(180),CU-TI(180),PB-TI(180),CO-TI(180),V-TI(180),MG-TI(180),FE-TI(180),MN-TI(180),HG-T(28),CA-TI(180),NA-TI(180),K-TI(180),CD-TI(180)
L2565313-03F	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-03G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-04A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565313-04B	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:49	NYTCL-8260HLW(14)
L2565313-04C	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:49	NYTCL-8260HLW(14)
L2565313-04D	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565313-04E	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),AS-TI(180),BA-TI(180),AG-TI(180),TL-TI(180),AL-TI(180),CR-TI(180),NI-TI(180),CU-TI(180),SB-TI(180),PB-TI(180),ZN-TI(180),SE-TI(180),V-TI(180),CO-TI(180),MN-TI(180),HG-T(28),FE-TI(180),MG-TI(180),K-TI(180),CA-TI(180),CD-TI(180),NA-TI(180)
L2565313-04F	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-04G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-05A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)

*Values in parentheses indicate holding time in days

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565313
Report Date: 10/30/25

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565313-05B	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:49	NYTCL-8260HLW(14)
L2565313-05C	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:49	NYTCL-8260HLW(14)
L2565313-05D	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565313-05E	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),AS-TI(180),BA-TI(180),AG-TI(180),NI-TI(180),TL-TI(180),AL-TI(180),CR-TI(180),ZN-TI(180),SE-TI(180),CU-TI(180),PB-TI(180),SB-TI(180),V-TI(180),CO-TI(180),FE-TI(180),MN-TI(180),MG-TI(180),HG-T(28),CA-TI(180),K-TI(180),CD-TI(180),NA-TI(180)
L2565313-05F	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-05G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-06A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565313-06B	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:51	NYTCL-8260HLW(14)
L2565313-06C	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:51	NYTCL-8260HLW(14)
L2565313-06D	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565313-06E	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),AS-TI(180),BA-TI(180),AG-TI(180),CR-TI(180),AL-TI(180),TL-TI(180),NI-TI(180),CU-TI(180),ZN-TI(180),PB-TI(180),SB-TI(180),SE-TI(180),CO-TI(180),V-TI(180),HG-T(28),MN-TI(180),MG-TI(180),FE-TI(180),CA-TI(180),CD-TI(180),NA-TI(180),K-TI(180)
L2565313-06F	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-06G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-07A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565313-07B	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:51	NYTCL-8260HLW(14)
L2565313-07C	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:51	NYTCL-8260HLW(14)
L2565313-07D	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)

*Values in parentheses indicate holding time in days

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565313
Report Date: 10/30/25

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565313-07E	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),AS-TI(180),BA-TI(180),AG-TI(180),CR-TI(180),AL-TI(180),NI-TI(180),TL-TI(180),CU-TI(180),PB-TI(180),ZN-TI(180),SE-TI(180),SB-TI(180),V-TI(180),CO-TI(180),MN-TI(180),FE-TI(180),HG-T(28),MG-TI(180),CD-TI(180),CA-TI(180),NA-TI(180),K-TI(180)
L2565313-07F	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-07G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-08A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565313-08B	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:51	NYTCL-8260HLW(14)
L2565313-08C	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:51	NYTCL-8260HLW(14)
L2565313-08D	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565313-08E	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),BA-TI(180),AS-TI(180),AG-TI(180),TL-TI(180),AL-TI(180),NI-TI(180),CR-TI(180),CU-TI(180),SE-TI(180),PB-TI(180),SB-TI(180),ZN-TI(180),CO-TI(180),V-TI(180),FE-TI(180),HG-T(28),MG-TI(180),MN-TI(180),K-TI(180),CD-TI(180),NA-TI(180),CA-TI(180)
L2565313-08F	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-08G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-09A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565313-09B	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:51	NYTCL-8260HLW(14)
L2565313-09C	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:51	NYTCL-8260HLW(14)
L2565313-09D	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)

*Values in parentheses indicate holding time in days

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565313
Report Date: 10/30/25

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565313-09E	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),BA-TI(180),AS-TI(180),AG-TI(180),CR-TI(180),TL-TI(180),NI-TI(180),AL-TI(180),CU-TI(180),PB-TI(180),ZN-TI(180),SB-TI(180),SE-TI(180),CO-TI(180),V-TI(180),MN-TI(180),FE-TI(180),HG-T(28),MG-TI(180),NA-TI(180),CA-TI(180),CD-TI(180),K-TI(180)
L2565313-09F	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-09G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-10A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565313-10B	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:51	NYTCL-8260HLW(14)
L2565313-10C	Vial water preserved	NA	NA			Y	Absent	16-OCT-25 06:51	NYTCL-8260HLW(14)
L2565313-10D	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565313-10E	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),AS-TI(180),BA-TI(180),AG-TI(180),TL-TI(180),AL-TI(180),CR-TI(180),NI-TI(180),SE-TI(180),ZN-TI(180),SB-TI(180),CU-TI(180),PB-TI(180),CO-TI(180),V-TI(180),MG-TI(180),HG-T(28),FE-TI(180),MN-TI(180),NA-TI(180),CD-TI(180),K-TI(180),CA-TI(180)
L2565313-10F	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),NYTCL-8082(365),HEXCR-7196(30)
L2565313-10G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),NYTCL-8082(365),HEXCR-7196(30)

*Values in parentheses indicate holding time in days

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565313
Project Number:	170859701	**Report Date:**	10/30/25

GLOSSARY

Acronyms

DL	- Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the limit of quantitation (LOQ). The DL includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)
EDL	- Estimated Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the reporting limit (RL). The EDL includes any adjustments from dilutions, concentrations or moisture content, where applicable. The use of EDLs is specific to the analysis of PAHs using Solid-Phase Microextraction (SPME).
EMPC	- Estimated Maximum Possible Concentration: The concentration that results from the signal present at the retention time of an analyte when the ions meet all of the identification criteria except the ion abundance ratio criteria. An EMPC is a worst-case estimate of the concentration.
EPA	- Environmental Protection Agency.
LCS	- Laboratory Control Sample: A sample matrix, free from the analytes of interest, spiked with verified known amounts of analytes or a material containing known and verified amounts of analytes.
LCSD	- Laboratory Control Sample Duplicate: Refer to LCS.
LFB	- Laboratory Fortified Blank: A sample matrix, free from the analytes of interest, spiked with verified known amounts of analytes or a material containing known and verified amounts of analytes.
LOD	- Limit of Detection: This value represents the level to which a target analyte can reliably be detected for a specific analyte in a specific matrix by a specific method. The LOD includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)
LOQ	- Limit of Quantitation: The value at which an instrument can accurately measure an analyte at a specific concentration. The LOQ includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.) Limit of Quantitation: The value at which an instrument can accurately measure an analyte at a specific concentration. The LOQ includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)
MDL	- Method Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the reporting limit (RL). The MDL includes any adjustments from dilutions, concentrations or moisture content, where applicable.
MS	- Matrix Spike Sample: A sample prepared by adding a known mass of target analyte to a specified amount of matrix sample for which an independent estimate of target analyte concentration is available. For Method 332.0, the spike recovery is calculated using the native concentration, including estimated values.
MSD	- Matrix Spike Sample Duplicate: Refer to MS.
NA	- Not Applicable.
NC	- Not Calculated: Term is utilized when one or more of the results utilized in the calculation are non-detect at the parameter's reporting unit.
NDPA/DPA	- N-Nitrosodiphenylamine/Diphenylamine.
NI	- Not Ignitable.
NP	- Non-Plastic: Term is utilized for the analysis of Atterberg Limits in soil.
NR	- No Results: Term is utilized when 'No Target Compounds Requested' is reported for the analysis of Volatile or Semivolatile Organic TIC only requests.
RL	- Reporting Limit: The value at which an instrument can accurately measure an analyte at a specific concentration. The RL includes any adjustments from dilutions, concentrations or moisture content, where applicable.
RPD	- Relative Percent Difference: The results from matrix and/or matrix spike duplicates are primarily designed to assess the precision of analytical results in a given matrix and are expressed as relative percent difference (RPD). Values which are less than five times the reporting limit for any individual parameter are evaluated by utilizing the absolute difference between the values; although the RPD value will be provided in the report.
SRM	- Standard Reference Material: A reference sample of a known or certified value that is of the same or similar matrix as the associated field samples.
STLP	- Semi-dynamic Tank Leaching Procedure per EPA Method 1315.
TEF	- Toxic Equivalency Factors: The values assigned to each dioxin and furan to evaluate their toxicity relative to 2,3,7,8-TCDD.
TEQ	- Toxic Equivalent: The measure of a sample's toxicity derived by multiplying each dioxin and furan by its corresponding TEF and then summing the resulting values.
TIC	- Tentatively Identified Compound: A compound that has been identified to be present and is not part of the target compound list (TCL) for the method and/or program. All TICs are qualitatively identified and reported as estimated concentrations.

Report Format: DU Report with 'J' Qualifiers

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565313
Project Number:	170859701	**Report Date:**	10/30/25

Footnotes

1 - The reference for this analyte should be considered modified since this analyte is absent from the target analyte list of the original method.

Terms

Analytical Method: Both the document from which the method originates and the analytical reference method. (Example: EPA 8260B is shown as 1,8260B.) The codes for the reference method documents are provided in the References section of the Addendum.

Chlordane: The target compound Chlordane (CAS No. 57-74-9) is reported for GC ECD analyses. Per EPA,this compound "refers to a mixture of chlordane isomers, other chlorinated hydrocarbons and numerous other components." (Reference: USEPA Toxicological Review of Chlordane, In Support of Summary Information on the Integrated Risk Information System (IRIS), December 1997.)

Difference: With respect to Total Oxidizable Precursor (TOP) Assay analysis, the difference is defined as the Post-Treatment value minus the Pre-Treatment value.

Final pH: As it pertains to Sample Receipt & Container Information section of the report, Final pH reflects pH of container determined after adjustment at the laboratory, if applicable. If no adjustment required, value reflects Initial pH.

Frozen Date/Time: With respect to Volatile Organics in soil, Frozen Date/Time reflects the date/time at which associated Reagent Water-preserved vials were initially frozen. Note: If frozen date/time is beyond 48 hours from sample collection, value will be reflected in 'bold'.

Gasoline Range Organics (GRO): Gasoline Range Organics (GRO) results include all chromatographic peaks eluting from Methyl tert butyl ether through Naphthalene, with the exception of GRO analysis in support of State of Ohio programs, which includes all chromatographic peaks eluting from Hexane through Dodecane.

Initial pH: As it pertains to Sample Receipt & Container Information section of the report, Initial pH reflects pH of container determined upon receipt, if applicable.

PAH Total: With respect to Alkylated PAH analyses, the 'PAHs, Total' result is defined as the summation of results for all or a subset of the following compounds: Naphthalene, C1-C4 Naphthalenes, 2-Methylnaphthalene, 1-Methylnaphthalene, Biphenyl, Acenaphthylene, Acenaphthene, Fluorene, C1-C3 Fluorenes, Phenanthrene, C1-C4 Phenanthrenes/Anthracenes, Anthracene, Fluoranthene, Pyrene, C1-C4 Fluoranthenes/Pyrenes, Benz(a)anthracene, Chrysene, C1-C4 Chrysenes, Benzo(b)fluoranthene, Benzo(j)+(k)fluoranthene, Benzo(e)pyrene, Benzo(a)pyrene, Perylene, Indeno(1,2,3-cd)pyrene, Dibenz(ah)+(ac)anthracene, Benzo(g,h,i)perylene. If a 'Total' result is requested, the results of its individual components will also be reported.

PFAS Total: With respect to PFAS analyses, the 'PFAS, Total (5)' result is defined as the summation of results for: PFHpA, PFHxS, PFOA, PFNA and PFOS. In addition, the 'PFAS, Total (6)' result is defined as the summation of results for: PFHpA, PFHxS, PFOA, PFNA, PFDA and PFOS. For MassDEP DW compliance analysis only, the 'PFAS, Total (6)' result is defined as the summation of results at or above the RL. Note: If a 'Total' result is requested, the results of its individual components will also be reported.

Total: With respect to Organic analyses, a 'Total' result is defined as the summation of results for individual isomers or Aroclors. If a 'Total' result is requested, the results of its individual components will also be reported. This is applicable to 'Total' results for methods 8260, 8081 and 8082.

Data Qualifiers

A - Spectra identified as "Aldol Condensates" are byproducts of the extraction/concentration procedures when acetone is introduced in the process.

B - The analyte was detected above the reporting limit in the associated method blank. Flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank. For MCP-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank. For DOD-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank AND the analyte was detected above one-half the reporting limit (or above the reporting limit for common lab contaminants) in the associated method blank. For NJ-Air-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte above the reporting limit. For NJ-related projects (excluding Air), flag only applies to associated field samples that have detectable concentrations of the analyte, which was detected above the reporting limit in the associated method blank or above five times the reporting limit for common lab contaminants (Phthalates, Acetone, Methylene Chloride, 2-Butanone).

C - Co-elution: The target analyte co-elutes with a known lab standard (i.e. surrogate, internal standards, etc.) for co-extracted analyses.

D - Concentration of analyte was quantified from diluted analysis. Flag only applies to field samples that have detectable concentrations of the analyte.

E - Concentration of analyte exceeds the range of the calibration curve and/or linear range of the instrument.

F - The ratio of quantifier ion response to qualifier ion response falls outside of the laboratory criteria. Results are considered to be an estimated maximum concentration.

G - The concentration may be biased high due to matrix interferences (i.e, co-elution) with non-target compound(s). The result should be considered estimated.

H - The analysis of pH was performed beyond the regulatory-required holding time of 15 minutes from the time of sample collection.

I - The lower value for the two columns has been reported due to obvious interference.

J - Estimated value. The Target analyte concentration is below the quantitation limit (RL), but above the Method Detection Limit (MDL) or Estimated Detection Limit (EDL) for SPME-related analyses. This represents an estimated concentration for Tentatively Identified Compounds (TICs). For calculated parameters, this represents that one or more values used in the calculation were

Report Format: DU Report with 'J' Qualifiers

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565313
Project Number:	170859701	**Report Date:**	10/30/25

Data Qualifiers

estimated.

M - Reporting Limit (RL) exceeds the MCP CAM Reporting Limit for this analyte.

ND - Not detected at the method detection limit (MDL) for the sample, or estimated detection limit (EDL) for SPME-related analyses.

NJ - Presumptive evidence of compound. This represents an estimated concentration for Tentatively Identified Compounds (TICs), where the identification is based on a mass spectral library search.

P - The RPD between the results for the two columns exceeds the method-specified criteria.

Q - The quality control sample exceeds the associated acceptance criteria. For DOD-related projects, LCS and/or Continuing Calibration Standard exceedences are also qualified on all associated sample results. Note: This flag is not applicable for matrix spike recoveries when the sample concentration is greater than 4x the spike added or for batch duplicate RPD when the sample concentrations are less than 5x the RL. (Metals only.)

R - Analytical results are from sample re-analysis.

RE - Analytical results are from sample re-extraction.

S - Analytical results are from modified screening analysis.

V - The surrogate associated with this target analyte has a recovery outside the QC acceptance limits. (Applicable to MassDEP DW Compliance samples only.)

Z - The batch matrix spike and/or duplicate associated with this target analyte has a recovery/RPD outside the QC acceptance limits. (Applicable to MassDEP DW Compliance samples only.)

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565313

Project Number: 170859701 **Report Date:** 10/30/25

REFERENCES

1 Test Methods for Evaluating Solid Waste: Physical/Chemical Methods. EPA SW-846. Third Edition. Updates I - VI, 2018.

107 Calculation method.

121 Standard Methods for the Examination of Water and Wastewater. APHA-AWWA-WEF. Standard Methods Online.

LIMITATION OF LIABILITIES

Pace Analytical Services performs services with reasonable care and diligence normal to the analytical testing laboratory industry. In the event of an error, the sole and exclusive responsibility of Pace Analytical Services shall be to re-perform the work at it's own expense. In no event shall Pace Analytical Services be held liable for any incidental, consequential or special damages, including but not limited to, damages in any way connected with the use of, interpretation of, information or analysis provided by Pace Analytical Services.

We strongly urge our clients to comply with EPA protocol regarding sample volume, preservation, cooling, containers, sampling procedures, holding time and splitting of samples in the field.

Certification Information

The following analytes are not included in our Primary NELAP Scope of Accreditation:

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581
EPA 624.1: m/p-xylene, o-xylene, Naphthalene
EPA 625.1: alpha-Terpineol
EPA 8260D: NPW: 1,2,4,5-Tetramethylbenzene; 4-Ethyltoluene; SCM: Iodomethane (methyl iodide), 1,2,4,5-Tetramethylbenzene; 4-Ethyltoluene.
EPA 8270E: NPW: Dimethylnaphthalene,1,4-Diphenylhydrazine, alpha-Terpineol, Azobenzene; SCM: Dimethylnaphthalene,1,4-Diphenylhydrazine.
SM4500: NPW: Amenable Cyanide; SCM: Total Phosphorus, TKN, NO2, NO3.

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
SM 2540D: TSS.
EPA TO-15: Halothane, 2,4,4-Trimethyl-2-pentene, 2,4,4-Trimethyl-1-pentene, Thiophene, 2-Methylthiophene, 3-Methylthiophene, 2-Ethylthiophene, 1,2,3-Trimethylbenzene, Indan, Indene, 1,2,4,5-Tetramethylbenzene, Benzothiophene, 1-Methylnaphthalene.
MADEP-APH.
Nonpotable Water: EPA RSK-175 Dissolved Gases
Biological Tissue Matrix: EPA 3050B

Mansfield Facility – 120 Forbes Blvd. Mansfield, MA 02048
EPA TO-15: Halothane, 2,4,4-Trimethyl-2-pentene, 2,4,4-Trimethyl-1-pentene, Thiophene, 2-Methylthiophene, 3-Methylthiophene, 2-Ethylthiophene, 1,2,3-Trimethylbenzene, Indan, Indene, 1,2,4,5-Tetramethylbenzene, Benzothiophene, 1-Methylnaphthalene.
Nonpotable Water: EPA RSK-175 Dissolved Gases

The following test method is not included in our New Jersey Secondary NELAP Scope of Accreditation:

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
Determination of Selected Perfluorinated Alkyl Substances by Solid Phase Extraction and Liquid Chromatography/Tandem Mass Spectrometry Isotope Dilution (via Alpha SOP 23528)

The following analytes are included in our Massachusetts DEP Scope of Accreditation

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581

Drinking Water
EPA 300.0: Chloride, Nitrate-N, Fluoride, Sulfate; **EPA 353.2**: Nitrate-N, Nitrite-N; **SM4500NO3-F**: Nitrate-N, Nitrite-N; **SM4500F-C, SM4500CN-CE, EPA 180.1, SM2130B, SM4500Cl-D, SM2320B, SM2540C, SM4500H-B, SM4500NO2-B**
EPA 524.2: THMs and VOCs; **EPA 504.1:** EDB, DBCP.
Microbiology: **SM9215B; SM9223-P/A, SM9223B-Colilert-QT,SM9222D**.

Non-Potable Water
SM4500H,B, EPA 120.1, SM2510B, SM2540C, SM2320B, SM4500CL-E, SM4500F-BC, SM4500NH3-BH: Ammonia-N and Kjeldahl-N, **EPA 350.1**: Ammonia-N, **LACHAT 10-107-06-1-B**: Ammonia-N, **EPA 351.1, SM4500NO3-F, EPA 353.2**: Nitrate-N**, SM4500P-E, SM4500P-B, E, SM4500SO4-E, SM5220D, EPA 410.4, SM5210B, SM5310C, SM4500CL-D, SM4500CL-G, EPA 1664, EPA 420.1, SM4500-CN-CE, SM2540D, EPA 300: Chloride, Sulfate, Nitrate.**
EPA 624.1: Volatile Halocarbons & Aromatics,
EPA 608.3: Chlordane, Toxaphene, Aldrin, alpha-BHC, beta-BHC, gamma-BHC, delta-BHC, Dieldrin, DDD, DDE, DDT, Endosulfan I, Endosulfan II, Endosulfan sulfate, Endrin, Endrin Aldehyde, Heptachlor, Heptachlor Epoxide, PCBs
EPA 625.1: SVOC (Acid/Base/Neutral Extractables).
Microbiology: **SM9223B-Colilert-QT; Enterolert-QT.**

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048

Drinking Water
EPA 200.7: Al, Ba, Cd, Cr, Cu, Fe, Mn, Ni, Na, Ag, Ca, Zn. **EPA 200.8:** Al, Sb, As, Ba, Be, Cd, Cr, Cu, Pb, Mn, Ni, Se, Ag, TL, Zn. **EPA 245.1** Hg.
EPA 522, EPA 537.1.

Non-Potable Water
EPA 200.7: Al, Sb, As, Be, Cd, Ca, Cr, Co, Cu, Fe, Pb, Mg, Mn, Mo, Ni, K, Se, Ag, Na, Sr, TL, Ti, V, Zn.
EPA 200.8: Al, Sb**,** As, Be, Cd, Ca, Cr, Cu, Fe, Pb, Mg, Mn, Ni, K, Se, Ag, Na, TL, Zn.
EPA 245.1: Hg. **EPA 245.7:** Hg.
SM2340B

Certification IDs:

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581
CT PH-0826, IL 200077, IN C-MA-03, KY kY98045, ME MA00086, MD 348, MA M-MA086, NH 2064, NJ MA935, NY 11148, NC (DW) 25700, NC (NPW/SCM) 666, OR MA-1316, PA 68-03671, RI LAO00065, TX T104704476, VT VT-0935, VA 460195

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
MA M-MA00030, CT PH-0825, ANAB/DoD L2474, IL 200081, IN C-MA-04, KY KY98046, LA 85084, ME MA00030, MI 9110, MN 025-999-495, NH 2062, NJ MA015, NY 11627, NC (NPW/SCM) 685, OR MA-0262, PA 68-02089, RI LAO00299, TX T-104704419, VT VT-0015, VA 460194, WA C954

Mansfield Facility – 120 Forbes Blvd. Mansfield, MA 02048
ANAB/DoD L2474, LA 245052, ME MA01156, MN 025-999-498, NH 2249, NJ MA025, NY 12191, OR 4203, TX T104704583, VA 460311, WA C1104.

For a complete listing of analytes and methods, please contact your Project Manager.

L2565313
LANGAN – NYC

NEW YORK CHAIN OF CUSTODY

ALPHA ANALYTICAL LABORATORIES

Westborough, MA 01581
8 Walkup Dr.
TEL: 508-898-9220
FAX: 508-898-9193

Mansfield, MA 02048
320 Forbes Blvd
TEL: 508-822-9300
FAX: 508-822-3288

Service Centers
Mahwah, NJ 07430: 35 Whitney Rd, Suite 5
Albany, NY 12205: 14 Walker Way
Tonawanda, NY 14150: 275 Cooper Ave, Suite 105

Page 1 of 1

Date Rec'd in Lab 10/16/25

Client Information
Client: Langan Engineering
Address: 368 9th Ave, 8th Fl
New York, NY 10001
Phone: 212-479-5402
Fax: N/A
Email: LHaley@langan.com

Project Information
Project Name: East Adams Redevelopment Phase II
Project Location: Syracuse, NY
Project # 170859701
(Use Project name as Project #) ☐
Project Manager: Lexi Haley
ALPHAQuote #: 26297

Turn-Around Time
Standard ☒ Due Date:
Rush (only if pre approved) ☐ # of Days:

Deliverables
☒ ASP-A ☐ ASP-B
☐ EQuIS (1 File) ☐ EQuIS (4 File)
☐ Other

☒ Same as Client info
PO #

Regulatory Requirement
☐ NY TOGS ☒ NY Part 375
☐ AWQ Standards ☐ NY CP-51
☐ NY Restricted Use ☐ Other
☐ NY Unrestricted Use
☐ NYC Sewer Discharge

Disposal Site Information
Please identify below location of applicable disposal facilities.
Disposal Facility:
☐ NJ ☐ NY
☐ Other:

These samples have been previously analyzed by Alpha ☐

Other project specific requirements/comments:
Please cc. ksemon@langan.com, pdinardo@langan.com, and jdatamanagement@langan.com

Please specify Metals or TAL.

ANALYSIS

Sample Filtration
☐ Done
☐ Lab to do
Preservation
☐ Lab to do
(Please Specify below)

ALPHA Lab ID (Lab Use Only)	Sample ID	Collection Date	Collection Time	Sample Matrix	Sampler's Initials	Part 375/TCL VOCs	PCBs, pesticides, herbicides	TAL metals (+ hex/tri chromium)	Total cyanide	Sample Specific Comments	Total Bottle
65313-1	PGSB03-1-2	10/15/25	0940	S	AMB	X	X	X	X		7
-2	PGSB03-4-5		1000		AMB	X	X	X	X	Hold pest./herb	7
-3	PGSB04-0-1		1100		AMB	X	X	X	X		7
-4	PGSB04-4-5		1140		AMB	X	X	X	X	Hold pest./herb	7
-5	PGSB10-0-2 (AMB)		1220		AMB	X	X	X	X		7
-6	PGSB10-2-3		1245		AMB	X	X	X	X	Hold pest./herb	7
-7	PGSB07-1-2		1345		AMB	X	X	X	X		7
-8	PGSB07-2-3		1415		AMB	X	X	X	X	Hold pest./herb	7
-9	PGSB06-0-1		1430		AMB	X	X	X	X		7
-10	PGSB06-3-4		1450		AMB	X	X	X	X	Hold pest./herb	7

Container Type	V	A	A	A
Preservative	FO	A	A	A

Preservative Code:
A = None
B = HCl
C = HNO_3
D = H_2SO_4
E = NaOH
F = MeOH
G = $NaHSO_4$
H = $Na_2S_2O_3$
K/E = Zn Ac/NaOH
O = Other

Container Code
P = Plastic
A = Amber Glass
V = Vial
G = Glass
B = Bacteria Cup
C = Cube
O = Other
E = Encore
D = BOD Bottle

Westboro: Certification No: MA935
Mansfield: Certification No: MA015

Relinquished By:	Date/Time	Received By:	Date/Time
Alyssa Langan	10/15/25 1600		10/15/25 1604
	10/15/25 1630		10/15/25 1730
	10-15-25		10/16 0200

Please print clearly, legibly and completely. Samples can not be logged in and turnaround time clock will not start until any ambiguities are resolved. BY EXECUTING THIS COC, THE CLIENT HAS READ AND AGREES TO BE BOUND BY ALPHA'S TERMS & CONDITIONS. (See reverse side.)

Form No: 01-25 HC (rev. 30-Sept-2013)

Sample Delivery Group Summary

Pace Job Number : L2565313
Received : 15-OCT-2025
Reviewer : Mohammed Wahed

Account Name : Langan Engineering & Environmental
Project Number : 170859701
Project Name : EAST ADAMS REDEVELOPMENT PHVI

Delivery Information

Samples Delivered By : Pace Courier

Chain of Custody : Present

Cooler Information

Cooler	Seal/Seal#	Preservation	Temperature(°C)	Additional Information
A	Absent/	Ice	4.4	
B	Absent/	Ice	4.0	

Condition Information

1) All samples on COC received?	**YES**
2) Extra samples received?	**NO**
3) Are there any sample container discrepancies?	**NO**
4) Are there any discrepancies between COC & sample labels?	**NO**
5) Are samples in appropriate containers for requested analysis?	**YES**
6) Are samples properly preserved for requested analysis?	**YES**
7) Are samples within holding time for requested analysis?	**YES**
8) All sampling equipment returned?	**NA**

Volatile Organics/VPH

1) Reagent Water Vials Frozen by Client?	**NO**

ANALYTICAL REPORT

Lab Number:	L2565714
Client:	Langan Engineering & Environmental 21 Penn Plaza 360 West 31st Street, 8th Floor New York, NY 10001-2727
ATTN:	Lexi Haley
Phone:	(212) 479-5499
Project Name:	EAST ADAMS REDEVELOPMENT PHVI
Project Number:	170859701
Report Date:	10/30/25

The original project report/data package is held by Pace Analytical Services. This report/data package is paginated and should be reproduced only in its entirety. Pace Analytical Services holds no responsibility for results and/or data that are not consistent with the original.

Certifications & Approvals: MA (M-MA086), NH NELAP (2064), CT (PH-0826), IL (200077), IN (C-MA-03), KY (KY98045), ME (MA00086), MD (348), NJ (MA935), NY (11148), NC (25700/666), OR (MA-1316), PA (68-03671), RI (LAO00065), TX (T104704476), VT (VT-0935), VA (460195), USDA (Permit #525-23-122-91930A1).

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565714
Report Date: 10/30/25

Lab Sample ID	Client ID	Matrix	Sample Location	Collection Date/Time	Receive Date
L2565714-01	P6SB02_1-2	SOIL	SYRACUSE NY	10/16/25 08:15	10/16/25
L2565714-02	P6SB02_3-4	SOIL	SYRACUSE NY	10/16/25 08:45	10/16/25
L2565714-03	P6SB09_1-2	SOIL	SYRACUSE NY	10/16/25 10:30	10/16/25
L2565714-04	P6SB09_3-4	SOIL	SYRACUSE NY	10/16/25 10:45	10/16/25
L2565714-05	P6SB08_0-1	SOIL	SYRACUSE NY	10/16/25 09:20	10/16/25
L2565714-06	P6SB08_2-3	SOIL	SYRACUSE NY	10/16/25 09:40	10/16/25
L2565714-07	P6SB01_0-1	SOIL	SYRACUSE NY	10/16/25 13:00	10/16/25
L2565714-08	P6SB01_5-6	SOIL	SYRACUSE NY	10/16/25 13:45	10/16/25
L2565714-09	P6SB05_1-2	SOIL	SYRACUSE NY	10/16/25 14:05	10/16/25
L2565714-10	P6SB05_5-6	SOIL	SYRACUSE NY	10/16/25 14:30	10/16/25

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565714
Project Number:	170859701	**Report Date:**	10/30/25

Case Narrative

The samples were received in accordance with the Chain of Custody and no significant deviations were encountered during the preparation or analysis unless otherwise noted. Sample Receipt, Container Information, and the Chain of Custody are located at the back of the report.

Results contained within this report relate only to the samples submitted under this Pace Lab Number and meet NELAP requirements for all NELAP accredited parameters unless otherwise noted in the following narrative. The data presented in this report is organized by parameter (i.e. VOC, SVOC, etc.). Sample specific Quality Control data (i.e. Surrogate Spike Recovery) is reported at the end of the target analyte list for each individual sample, followed by the Laboratory Batch Quality Control at the end of each parameter. Tentatively Identified Compounds (TICs), if requested, are reported for compounds identified to be present and are not part of the method/program Target Compound List, even if only a subset of the TCL are being reported. If a sample was re-analyzed or re-extracted due to a required quality control corrective action and if both sets of data are reported, the Laboratory ID of the re-analysis or re-extraction is designated with an "R" or "RE", respectively.

When multiple Batch Quality Control elements are reported (e.g. more than one LCS), the associated samples for each element are noted in the grey shaded header line of each data table. Any Laboratory Batch, Sample Specific % recovery or RPD value that is outside the listed Acceptance Criteria is bolded in the report. In reference to questions H (CAM) or 4 (RCP) when "NO" is checked, the performance criteria for CAM and RCP methods allow for some quality control failures to occur and still be within method compliance. In these instances, the specific failure is not narrated but noted in the associated QC Outlier Summary Report, located directly after the Case Narrative. QC information is also incorporated in the Data Usability Assessment table (Format 11) of our Data Merger tool, where it can be reviewed in conjunction with the sample result, associated regulatory criteria and any associated data usability implications.

Soil/sediments and solids are reported on a dry weight basis unless otherwise noted. Tissues are reported "as received" or on a wet weight basis, unless otherwise noted. Definitions of all data qualifiers and acronyms used in this report are provided in the Glossary located at the back of the report.

HOLD POLICY - For samples submitted on hold, Pace's policy is to hold samples (with the exception of Air canisters) free of charge for 21 calendar days from the date the project is completed. After 21 calendar days, we will dispose of all samples submitted including those put on hold unless you have contacted your Pace Project Manager and made arrangements for Pace to continue to hold the samples. Air canisters will be disposed after 3 business days from the date the project is completed.

Please contact Project Management at 800-624-9220 with any questions.

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565714
Project Number:	170859701	**Report Date:**	10/30/25

Case Narrative (continued)

Report Submission

October 30, 2025: This final report includes the results of all requested analyses.

October 29, 2025: This is a preliminary report.

All non-detect (ND) or estimated concentrations (J-qualified) have been quantitated to the limit noted in the MDL column.

Sample Receipt

L2565714-06: The collection date and time on the chain of custody was 16-OCT-25 09:40; however, the collection date/time on the container label was 16-OCT-25 09:45. At the client's request, the collection date/time is reported as 16-OCT-25 09:40.

Volatile Organics

L2565714-10: The internal standard (IS) responses for fluorobenzene (13%), chlorobenzene-d5 (16%), and 1,4-dichlorobenzene-d4 (14%) and the surrogate recoveries for 1,2-dichloroethane-d4 (235%) and dibromofluoromethane (194%) were outside the acceptance criteria; however, re-analysis achieved the following results: fluorobenzene (21%), chlorobenzene-d5 (22%), 1,4-dichlorobenzene-d4 (19%), dibromofluoromethane (184%), and 1,2-dichloroethane-d4 (157%). The results of both analyses are reported.

Total Metals

L2565714-01 through 10: The sample has elevated detection limits for all elements, with the exception of mercury, due to the dilution required by the sample matrix.

The WG2130788-3 MS recoveries performed on L2565714-01 do not apply for aluminum (1840%), calcium (0%), iron (0%), magnesium (466%), and manganese (0%) because the sample concentrations are greater than four times the spike amounts added.

The WG2130788-3 MS recoveries performed on L2565714-01 are outside the acceptance criteria for antimony (47%), arsenic (36%), copper (0%), nickel (67%), sodium (142%), and zinc (128%). A post digestion

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565714
Project Number:	170859701	**Report Date:**	10/30/25

Case Narrative (continued)

spike was performed and was within acceptance criteria.

The WG2130788-4 Laboratory Duplicate RPDs performed on L2565714-01 are outside the acceptance criteria for aluminum (31%), arsenic (114%), calcium (38%), copper (71%), iron (100%), lead (70%), manganese (57%), nickel (43%), vanadium (24%), and zinc (42%) due to the non-homogeneous nature of the native sample.

I, the undersigned, attest under the pains and penalties of perjury that, to the best of my knowledge and belief and based upon my personal inquiry of those responsible for providing the information contained in this analytical report, such information is accurate and complete. This certificate of analysis is not complete unless this page accompanies any and all pages of this report.

Authorized Signature: Kelly Stenstrom

Title: Technical Director/Representative Date: 10/30/25

ORGANICS

VOLATILES

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-01
Client ID: P6SB02_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 08:15
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/29/25 13:45
Analyst: AJK
Percent Solids: 77%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	7.4	3.4	1
1,1-Dichloroethane	ND		ug/kg	1.5	0.22	1
Chloroform	0.29	J	ug/kg	2.2	0.21	1
Carbon tetrachloride	ND		ug/kg	1.5	0.34	1
1,2-Dichloropropane	ND		ug/kg	1.5	0.19	1
Dibromochloromethane	ND		ug/kg	1.5	0.21	1
1,1,2-Trichloroethane	ND		ug/kg	1.5	0.40	1
Tetrachloroethene	ND		ug/kg	0.74	0.29	1
Chlorobenzene	ND		ug/kg	0.74	0.19	1
Trichlorofluoromethane	ND		ug/kg	6.0	1.0	1
1,2-Dichloroethane	ND		ug/kg	1.5	0.38	1
1,1,1-Trichloroethane	ND		ug/kg	0.74	0.25	1
Bromodichloromethane	ND		ug/kg	0.74	0.16	1
trans-1,3-Dichloropropene	ND		ug/kg	1.5	0.41	1
cis-1,3-Dichloropropene	ND		ug/kg	0.74	0.24	1
1,3-Dichloropropene, Total	ND		ug/kg	0.74	0.24	1
1,1-Dichloropropene	ND		ug/kg	0.74	0.24	1
Bromoform	ND		ug/kg	6.0	0.37	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.74	0.25	1
Benzene	ND		ug/kg	0.74	0.25	1
Toluene	ND		ug/kg	1.5	0.81	1
Ethylbenzene	ND		ug/kg	1.5	0.21	1
Chloromethane	ND		ug/kg	6.0	1.4	1
Bromomethane	ND		ug/kg	3.0	0.86	1
Vinyl chloride	ND		ug/kg	1.5	0.50	1
Chloroethane	ND		ug/kg	3.0	0.67	1
1,1-Dichloroethene	ND		ug/kg	1.5	0.35	1
trans-1,2-Dichloroethene	ND		ug/kg	2.2	0.20	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-01 Date Collected: 10/16/25 08:15

Client ID: P6SB02_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.74	0.20	1
1,2-Dichlorobenzene	ND		ug/kg	3.0	0.21	1
1,3-Dichlorobenzene	ND		ug/kg	3.0	0.22	1
1,4-Dichlorobenzene	ND		ug/kg	3.0	0.25	1
Methyl tert butyl ether	ND		ug/kg	3.0	0.30	1
p/m-Xylene	ND		ug/kg	3.0	0.83	1
o-Xylene	ND		ug/kg	1.5	0.43	1
Xylenes, Total	ND		ug/kg	1.5	0.43	1
cis-1,2-Dichloroethene	ND		ug/kg	1.5	0.26	1
1,2-Dichloroethene, Total	ND		ug/kg	1.5	0.20	1
Dibromomethane	ND		ug/kg	3.0	0.35	1
Styrene	ND		ug/kg	1.5	0.29	1
Dichlorodifluoromethane	ND		ug/kg	15	1.4	1
Acetone	ND		ug/kg	15	7.2	1
Carbon disulfide	ND		ug/kg	15	6.8	1
2-Butanone	ND		ug/kg	15	3.3	1
Vinyl acetate	ND		ug/kg	15	3.2	1
4-Methyl-2-pentanone	ND		ug/kg	15	1.9	1
1,2,3-Trichloropropane	ND		ug/kg	3.0	0.19	1
2-Hexanone	ND		ug/kg	15	1.8	1
Bromochloromethane	ND		ug/kg	3.0	0.30	1
2,2-Dichloropropane	ND		ug/kg	3.0	0.30	1
1,2-Dibromoethane	ND		ug/kg	1.5	0.42	1
1,3-Dichloropropane	ND		ug/kg	3.0	0.25	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.74	0.20	1
Bromobenzene	ND		ug/kg	3.0	0.22	1
n-Butylbenzene	ND		ug/kg	1.5	0.25	1
sec-Butylbenzene	ND		ug/kg	1.5	0.22	1
tert-Butylbenzene	ND		ug/kg	3.0	0.18	1
o-Chlorotoluene	ND		ug/kg	3.0	0.28	1
p-Chlorotoluene	ND		ug/kg	3.0	0.16	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	4.5	1.5	1
Hexachlorobutadiene	ND		ug/kg	6.0	0.25	1
Isopropylbenzene	ND		ug/kg	1.5	0.16	1
p-Isopropyltoluene	ND		ug/kg	1.5	0.16	1
Naphthalene	ND		ug/kg	6.0	0.97	1
Acrylonitrile	ND		ug/kg	6.0	1.7	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-01 Date Collected: 10/16/25 08:15

Client ID: P6SB02_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.5	0.25	1
1,2,3-Trichlorobenzene	ND		ug/kg	3.0	0.48	1
1,2,4-Trichlorobenzene	ND		ug/kg	3.0	0.40	1
1,3,5-Trimethylbenzene	ND		ug/kg	3.0	0.29	1
1,2,4-Trimethylbenzene	ND		ug/kg	3.0	0.50	1
1,4-Dioxane	ND		ug/kg	120	52.	1
p-Diethylbenzene	ND		ug/kg	3.0	0.26	1
p-Ethyltoluene	ND		ug/kg	3.0	0.57	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	3.0	0.28	1
Ethyl ether	ND		ug/kg	3.0	0.51	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	7.4	2.1	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**132**	Q	70-130
Toluene-d8	96		70-130
4-Bromofluorobenzene	90		70-130
Dibromofluoromethane	**134**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-02
Client ID: P6SB02_3-4
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 08:45
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/29/25 14:12
Analyst: AJK
Percent Solids: 82%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	9.2	4.2	1
1,1-Dichloroethane	ND		ug/kg	1.8	0.27	1
Chloroform	0.34	J	ug/kg	2.8	0.26	1
Carbon tetrachloride	ND		ug/kg	1.8	0.42	1
1,2-Dichloropropane	ND		ug/kg	1.8	0.23	1
Dibromochloromethane	ND		ug/kg	1.8	0.26	1
1,1,2-Trichloroethane	ND		ug/kg	1.8	0.49	1
Tetrachloroethene	ND		ug/kg	0.92	0.36	1
Chlorobenzene	ND		ug/kg	0.92	0.23	1
Trichlorofluoromethane	ND		ug/kg	7.4	1.3	1
1,2-Dichloroethane	ND		ug/kg	1.8	0.47	1
1,1,1-Trichloroethane	ND		ug/kg	0.92	0.31	1
Bromodichloromethane	ND		ug/kg	0.92	0.20	1
trans-1,3-Dichloropropene	ND		ug/kg	1.8	0.50	1
cis-1,3-Dichloropropene	ND		ug/kg	0.92	0.29	1
1,3-Dichloropropene, Total	ND		ug/kg	0.92	0.29	1
1,1-Dichloropropene	ND		ug/kg	0.92	0.29	1
Bromoform	ND		ug/kg	7.4	0.45	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.92	0.31	1
Benzene	ND		ug/kg	0.92	0.31	1
Toluene	ND		ug/kg	1.8	1.0	1
Ethylbenzene	ND		ug/kg	1.8	0.26	1
Chloromethane	ND		ug/kg	7.4	1.7	1
Bromomethane	ND		ug/kg	3.7	1.1	1
Vinyl chloride	ND		ug/kg	1.8	0.62	1
Chloroethane	ND		ug/kg	3.7	0.83	1
1,1-Dichloroethene	ND		ug/kg	1.8	0.44	1
trans-1,2-Dichloroethene	ND		ug/kg	2.8	0.25	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-02 Date Collected: 10/16/25 08:45

Client ID: P6SB02_3-4 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.92	0.25	1
1,2-Dichlorobenzene	ND		ug/kg	3.7	0.26	1
1,3-Dichlorobenzene	ND		ug/kg	3.7	0.27	1
1,4-Dichlorobenzene	ND		ug/kg	3.7	0.32	1
Methyl tert butyl ether	ND		ug/kg	3.7	0.37	1
p/m-Xylene	ND		ug/kg	3.7	1.0	1
o-Xylene	ND		ug/kg	1.8	0.54	1
Xylenes, Total	ND		ug/kg	1.8	0.54	1
cis-1,2-Dichloroethene	ND		ug/kg	1.8	0.32	1
1,2-Dichloroethene, Total	ND		ug/kg	1.8	0.25	1
Dibromomethane	ND		ug/kg	3.7	0.44	1
Styrene	ND		ug/kg	1.8	0.36	1
Dichlorodifluoromethane	ND		ug/kg	18	1.7	1
Acetone	ND		ug/kg	18	8.9	1
Carbon disulfide	ND		ug/kg	18	8.4	1
2-Butanone	ND		ug/kg	18	4.1	1
Vinyl acetate	ND		ug/kg	18	4.0	1
4-Methyl-2-pentanone	ND		ug/kg	18	2.4	1
1,2,3-Trichloropropane	ND		ug/kg	3.7	0.23	1
2-Hexanone	ND		ug/kg	18	2.2	1
Bromochloromethane	ND		ug/kg	3.7	0.38	1
2,2-Dichloropropane	ND		ug/kg	3.7	0.37	1
1,2-Dibromoethane	ND		ug/kg	1.8	0.52	1
1,3-Dichloropropane	ND		ug/kg	3.7	0.31	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.92	0.24	1
Bromobenzene	ND		ug/kg	3.7	0.27	1
n-Butylbenzene	ND		ug/kg	1.8	0.31	1
sec-Butylbenzene	ND		ug/kg	1.8	0.27	1
tert-Butylbenzene	ND		ug/kg	3.7	0.22	1
o-Chlorotoluene	ND		ug/kg	3.7	0.35	1
p-Chlorotoluene	ND		ug/kg	3.7	0.20	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	5.5	1.8	1
Hexachlorobutadiene	ND		ug/kg	7.4	0.31	1
Isopropylbenzene	ND		ug/kg	1.8	0.20	1
p-Isopropyltoluene	ND		ug/kg	1.8	0.20	1
Naphthalene	ND		ug/kg	7.4	1.2	1
Acrylonitrile	ND		ug/kg	7.4	2.1	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-02 Date Collected: 10/16/25 08:45

Client ID: P6SB02_3-4 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.8	0.32	1
1,2,3-Trichlorobenzene	ND		ug/kg	3.7	0.59	1
1,2,4-Trichlorobenzene	ND		ug/kg	3.7	0.50	1
1,3,5-Trimethylbenzene	ND		ug/kg	3.7	0.36	1
1,2,4-Trimethylbenzene	ND		ug/kg	3.7	0.62	1
1,4-Dioxane	ND		ug/kg	150	65.	1
p-Diethylbenzene	ND		ug/kg	3.7	0.33	1
p-Ethyltoluene	ND		ug/kg	3.7	0.71	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	3.7	0.35	1
Ethyl ether	ND		ug/kg	3.7	0.63	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	9.2	2.6	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**133**	Q	70-130
Toluene-d8	96		70-130
4-Bromofluorobenzene	86		70-130
Dibromofluoromethane	**131**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-03
Client ID: P6SB09_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 10:30
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/29/25 14:40
Analyst: AJK
Percent Solids: 87%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	10	4.6	1
1,1-Dichloroethane	ND		ug/kg	2.0	0.29	1
Chloroform	0.36	J	ug/kg	3.0	0.28	1
Carbon tetrachloride	ND		ug/kg	2.0	0.46	1
1,2-Dichloropropane	ND		ug/kg	2.0	0.25	1
Dibromochloromethane	ND		ug/kg	2.0	0.28	1
1,1,2-Trichloroethane	ND		ug/kg	2.0	0.54	1
Tetrachloroethene	ND		ug/kg	1.0	0.39	1
Chlorobenzene	ND		ug/kg	1.0	0.25	1
Trichlorofluoromethane	ND		ug/kg	8.0	1.4	1
1,2-Dichloroethane	ND		ug/kg	2.0	0.52	1
1,1,1-Trichloroethane	ND		ug/kg	1.0	0.33	1
Bromodichloromethane	ND		ug/kg	1.0	0.22	1
trans-1,3-Dichloropropene	ND		ug/kg	2.0	0.55	1
cis-1,3-Dichloropropene	ND		ug/kg	1.0	0.32	1
1,3-Dichloropropene, Total	ND		ug/kg	1.0	0.32	1
1,1-Dichloropropene	ND		ug/kg	1.0	0.32	1
Bromoform	ND		ug/kg	8.0	0.49	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	1.0	0.33	1
Benzene	ND		ug/kg	1.0	0.33	1
Toluene	ND		ug/kg	2.0	1.1	1
Ethylbenzene	ND		ug/kg	2.0	0.28	1
Chloromethane	ND		ug/kg	8.0	1.9	1
Bromomethane	ND		ug/kg	4.0	1.2	1
Vinyl chloride	ND		ug/kg	2.0	0.67	1
Chloroethane	ND		ug/kg	4.0	0.91	1
1,1-Dichloroethene	ND		ug/kg	2.0	0.48	1
trans-1,2-Dichloroethene	ND		ug/kg	3.0	0.27	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-03 Date Collected: 10/16/25 10:30

Client ID: P6SB09_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	1.0	0.27	1
1,2-Dichlorobenzene	ND		ug/kg	4.0	0.29	1
1,3-Dichlorobenzene	ND		ug/kg	4.0	0.30	1
1,4-Dichlorobenzene	ND		ug/kg	4.0	0.34	1
Methyl tert butyl ether	ND		ug/kg	4.0	0.40	1
p/m-Xylene	ND		ug/kg	4.0	1.1	1
o-Xylene	ND		ug/kg	2.0	0.58	1
Xylenes, Total	ND		ug/kg	2.0	0.58	1
cis-1,2-Dichloroethene	ND		ug/kg	2.0	0.35	1
1,2-Dichloroethene, Total	ND		ug/kg	2.0	0.27	1
Dibromomethane	ND		ug/kg	4.0	0.48	1
Styrene	ND		ug/kg	2.0	0.39	1
Dichlorodifluoromethane	ND		ug/kg	20	1.8	1
Acetone	ND		ug/kg	20	9.6	1
Carbon disulfide	ND		ug/kg	20	9.1	1
2-Butanone	ND		ug/kg	20	4.4	1
Vinyl acetate	ND		ug/kg	20	4.3	1
4-Methyl-2-pentanone	ND		ug/kg	20	2.6	1
1,2,3-Trichloropropane	ND		ug/kg	4.0	0.25	1
2-Hexanone	ND		ug/kg	20	2.4	1
Bromochloromethane	ND		ug/kg	4.0	0.41	1
2,2-Dichloropropane	ND		ug/kg	4.0	0.40	1
1,2-Dibromoethane	ND		ug/kg	2.0	0.56	1
1,3-Dichloropropane	ND		ug/kg	4.0	0.33	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	1.0	0.26	1
Bromobenzene	ND		ug/kg	4.0	0.29	1
n-Butylbenzene	ND		ug/kg	2.0	0.33	1
sec-Butylbenzene	ND		ug/kg	2.0	0.29	1
tert-Butylbenzene	ND		ug/kg	4.0	0.24	1
o-Chlorotoluene	ND		ug/kg	4.0	0.38	1
p-Chlorotoluene	ND		ug/kg	4.0	0.22	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	6.0	2.0	1
Hexachlorobutadiene	ND		ug/kg	8.0	0.34	1
Isopropylbenzene	ND		ug/kg	2.0	0.22	1
p-Isopropyltoluene	ND		ug/kg	2.0	0.22	1
Naphthalene	ND		ug/kg	8.0	1.3	1
Acrylonitrile	ND		ug/kg	8.0	2.3	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-03 Date Collected: 10/16/25 10:30

Client ID: P6SB09_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	2.0	0.34	1
1,2,3-Trichlorobenzene	ND		ug/kg	4.0	0.64	1
1,2,4-Trichlorobenzene	ND		ug/kg	4.0	0.54	1
1,3,5-Trimethylbenzene	ND		ug/kg	4.0	0.39	1
1,2,4-Trimethylbenzene	ND		ug/kg	4.0	0.67	1
1,4-Dioxane	ND		ug/kg	160	70.	1
p-Diethylbenzene	ND		ug/kg	4.0	0.35	1
p-Ethyltoluene	ND		ug/kg	4.0	0.77	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	4.0	0.38	1
Ethyl ether	ND		ug/kg	4.0	0.68	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	10	2.8	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**136**	Q	70-130
Toluene-d8	97		70-130
4-Bromofluorobenzene	91		70-130
Dibromofluoromethane	**137**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-04
Client ID: P6SB09_3-4
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 10:45
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/29/25 15:07
Analyst: AJK
Percent Solids: 85%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	8.0	3.6	1
1,1-Dichloroethane	ND		ug/kg	1.6	0.23	1
Chloroform	0.32	J	ug/kg	2.4	0.22	1
Carbon tetrachloride	ND		ug/kg	1.6	0.37	1
1,2-Dichloropropane	ND		ug/kg	1.6	0.20	1
Dibromochloromethane	ND		ug/kg	1.6	0.22	1
1,1,2-Trichloroethane	ND		ug/kg	1.6	0.43	1
Tetrachloroethene	ND		ug/kg	0.80	0.31	1
Chlorobenzene	ND		ug/kg	0.80	0.20	1
Trichlorofluoromethane	ND		ug/kg	6.4	1.1	1
1,2-Dichloroethane	ND		ug/kg	1.6	0.41	1
1,1,1-Trichloroethane	ND		ug/kg	0.80	0.27	1
Bromodichloromethane	ND		ug/kg	0.80	0.17	1
trans-1,3-Dichloropropene	ND		ug/kg	1.6	0.44	1
cis-1,3-Dichloropropene	ND		ug/kg	0.80	0.25	1
1,3-Dichloropropene, Total	ND		ug/kg	0.80	0.25	1
1,1-Dichloropropene	ND		ug/kg	0.80	0.25	1
Bromoform	ND		ug/kg	6.4	0.39	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.80	0.26	1
Benzene	ND		ug/kg	0.80	0.26	1
Toluene	ND		ug/kg	1.6	0.87	1
Ethylbenzene	ND		ug/kg	1.6	0.22	1
Chloromethane	ND		ug/kg	6.4	1.5	1
Bromomethane	ND		ug/kg	3.2	0.93	1
Vinyl chloride	ND		ug/kg	1.6	0.54	1
Chloroethane	ND		ug/kg	3.2	0.72	1
1,1-Dichloroethene	ND		ug/kg	1.6	0.38	1
trans-1,2-Dichloroethene	ND		ug/kg	2.4	0.22	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-04 Date Collected: 10/16/25 10:45

Client ID: P6SB09_3-4 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.80	0.22	1
1,2-Dichlorobenzene	ND		ug/kg	3.2	0.23	1
1,3-Dichlorobenzene	ND		ug/kg	3.2	0.24	1
1,4-Dichlorobenzene	ND		ug/kg	3.2	0.27	1
Methyl tert butyl ether	ND		ug/kg	3.2	0.32	1
p/m-Xylene	ND		ug/kg	3.2	0.89	1
o-Xylene	ND		ug/kg	1.6	0.46	1
Xylenes, Total	ND		ug/kg	1.6	0.46	1
cis-1,2-Dichloroethene	ND		ug/kg	1.6	0.28	1
1,2-Dichloroethene, Total	ND		ug/kg	1.6	0.22	1
Dibromomethane	ND		ug/kg	3.2	0.38	1
Styrene	ND		ug/kg	1.6	0.31	1
Dichlorodifluoromethane	ND		ug/kg	16	1.5	1
Acetone	ND		ug/kg	16	7.7	1
Carbon disulfide	ND		ug/kg	16	7.3	1
2-Butanone	ND		ug/kg	16	3.5	1
Vinyl acetate	ND		ug/kg	16	3.4	1
4-Methyl-2-pentanone	ND		ug/kg	16	2.0	1
1,2,3-Trichloropropane	ND		ug/kg	3.2	0.20	1
2-Hexanone	ND		ug/kg	16	1.9	1
Bromochloromethane	ND		ug/kg	3.2	0.33	1
2,2-Dichloropropane	ND		ug/kg	3.2	0.32	1
1,2-Dibromoethane	ND		ug/kg	1.6	0.44	1
1,3-Dichloropropane	ND		ug/kg	3.2	0.27	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.80	0.21	1
Bromobenzene	ND		ug/kg	3.2	0.23	1
n-Butylbenzene	ND		ug/kg	1.6	0.27	1
sec-Butylbenzene	ND		ug/kg	1.6	0.23	1
tert-Butylbenzene	ND		ug/kg	3.2	0.19	1
o-Chlorotoluene	ND		ug/kg	3.2	0.30	1
p-Chlorotoluene	ND		ug/kg	3.2	0.17	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	4.8	1.6	1
Hexachlorobutadiene	ND		ug/kg	6.4	0.27	1
Isopropylbenzene	ND		ug/kg	1.6	0.17	1
p-Isopropyltoluene	ND		ug/kg	1.6	0.17	1
Naphthalene	ND		ug/kg	6.4	1.0	1
Acrylonitrile	ND		ug/kg	6.4	1.8	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-04 Date Collected: 10/16/25 10:45

Client ID: P6SB09_3-4 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.6	0.27	1
1,2,3-Trichlorobenzene	ND		ug/kg	3.2	0.51	1
1,2,4-Trichlorobenzene	ND		ug/kg	3.2	0.43	1
1,3,5-Trimethylbenzene	ND		ug/kg	3.2	0.31	1
1,2,4-Trimethylbenzene	ND		ug/kg	3.2	0.53	1
1,4-Dioxane	ND		ug/kg	130	56.	1
p-Diethylbenzene	ND		ug/kg	3.2	0.28	1
p-Ethyltoluene	ND		ug/kg	3.2	0.61	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	3.2	0.30	1
Ethyl ether	ND		ug/kg	3.2	0.54	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	8.0	2.3	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**132**	Q	70-130
Toluene-d8	95		70-130
4-Bromofluorobenzene	88		70-130
Dibromofluoromethane	**132**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-05
Client ID: P6SB08_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 09:20
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/29/25 15:35
Analyst: AJK
Percent Solids: 84%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	7.2	3.3	1
1,1-Dichloroethane	ND		ug/kg	1.4	0.21	1
Chloroform	0.33	J	ug/kg	2.2	0.20	1
Carbon tetrachloride	ND		ug/kg	1.4	0.33	1
1,2-Dichloropropane	ND		ug/kg	1.4	0.18	1
Dibromochloromethane	ND		ug/kg	1.4	0.20	1
1,1,2-Trichloroethane	ND		ug/kg	1.4	0.39	1
Tetrachloroethene	ND		ug/kg	0.72	0.28	1
Chlorobenzene	ND		ug/kg	0.72	0.18	1
Trichlorofluoromethane	ND		ug/kg	5.8	1.0	1
1,2-Dichloroethane	ND		ug/kg	1.4	0.37	1
1,1,1-Trichloroethane	ND		ug/kg	0.72	0.24	1
Bromodichloromethane	ND		ug/kg	0.72	0.16	1
trans-1,3-Dichloropropene	ND		ug/kg	1.4	0.40	1
cis-1,3-Dichloropropene	ND		ug/kg	0.72	0.23	1
1,3-Dichloropropene, Total	ND		ug/kg	0.72	0.23	1
1,1-Dichloropropene	ND		ug/kg	0.72	0.23	1
Bromoform	ND		ug/kg	5.8	0.36	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.72	0.24	1
Benzene	ND		ug/kg	0.72	0.24	1
Toluene	ND		ug/kg	1.4	0.79	1
Ethylbenzene	ND		ug/kg	1.4	0.20	1
Chloromethane	ND		ug/kg	5.8	1.4	1
Bromomethane	ND		ug/kg	2.9	0.84	1
Vinyl chloride	ND		ug/kg	1.4	0.48	1
Chloroethane	ND		ug/kg	2.9	0.66	1
1,1-Dichloroethene	ND		ug/kg	1.4	0.34	1
trans-1,2-Dichloroethene	ND		ug/kg	2.2	0.20	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-05 Date Collected: 10/16/25 09:20

Client ID: P6SB08_0-1 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.72	0.20	1
1,2-Dichlorobenzene	ND		ug/kg	2.9	0.21	1
1,3-Dichlorobenzene	ND		ug/kg	2.9	0.21	1
1,4-Dichlorobenzene	ND		ug/kg	2.9	0.25	1
Methyl tert butyl ether	ND		ug/kg	2.9	0.29	1
p/m-Xylene	ND		ug/kg	2.9	0.81	1
o-Xylene	ND		ug/kg	1.4	0.42	1
Xylenes, Total	ND		ug/kg	1.4	0.42	1
cis-1,2-Dichloroethene	ND		ug/kg	1.4	0.25	1
1,2-Dichloroethene, Total	ND		ug/kg	1.4	0.20	1
Dibromomethane	ND		ug/kg	2.9	0.34	1
Styrene	ND		ug/kg	1.4	0.28	1
Dichlorodifluoromethane	ND		ug/kg	14	1.3	1
Acetone	ND		ug/kg	14	7.0	1
Carbon disulfide	ND		ug/kg	14	6.6	1
2-Butanone	ND		ug/kg	14	3.2	1
Vinyl acetate	ND		ug/kg	14	3.1	1
4-Methyl-2-pentanone	ND		ug/kg	14	1.8	1
1,2,3-Trichloropropane	ND		ug/kg	2.9	0.18	1
2-Hexanone	ND		ug/kg	14	1.7	1
Bromochloromethane	ND		ug/kg	2.9	0.30	1
2,2-Dichloropropane	ND		ug/kg	2.9	0.29	1
1,2-Dibromoethane	ND		ug/kg	1.4	0.40	1
1,3-Dichloropropane	ND		ug/kg	2.9	0.24	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.72	0.19	1
Bromobenzene	ND		ug/kg	2.9	0.21	1
n-Butylbenzene	ND		ug/kg	1.4	0.24	1
sec-Butylbenzene	ND		ug/kg	1.4	0.21	1
tert-Butylbenzene	ND		ug/kg	2.9	0.17	1
o-Chlorotoluene	ND		ug/kg	2.9	0.28	1
p-Chlorotoluene	ND		ug/kg	2.9	0.16	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	4.4	1.4	1
Hexachlorobutadiene	ND		ug/kg	5.8	0.24	1
Isopropylbenzene	ND		ug/kg	1.4	0.16	1
p-Isopropyltoluene	ND		ug/kg	1.4	0.16	1
Naphthalene	1.3	J	ug/kg	5.8	0.94	1
Acrylonitrile	ND		ug/kg	5.8	1.7	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-05 Date Collected: 10/16/25 09:20

Client ID: P6SB08_0-1 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.4	0.25	1
1,2,3-Trichlorobenzene	ND		ug/kg	2.9	0.47	1
1,2,4-Trichlorobenzene	ND		ug/kg	2.9	0.39	1
1,3,5-Trimethylbenzene	ND		ug/kg	2.9	0.28	1
1,2,4-Trimethylbenzene	ND		ug/kg	2.9	0.48	1
1,4-Dioxane	ND		ug/kg	120	51.	1
p-Diethylbenzene	ND		ug/kg	2.9	0.26	1
p-Ethyltoluene	ND		ug/kg	2.9	0.56	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	2.9	0.28	1
Ethyl ether	ND		ug/kg	2.9	0.49	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	7.2	2.0	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**135**	Q	70-130
Toluene-d8	97		70-130
4-Bromofluorobenzene	88		70-130
Dibromofluoromethane	**135**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-06
Client ID: P6SB08_2-3
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 09:40
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/29/25 16:03
Analyst: AJK
Percent Solids: 73%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	12	5.7	1
1,1-Dichloroethane	ND		ug/kg	2.5	0.36	1
Chloroform	1.1	J	ug/kg	3.7	0.35	1
Carbon tetrachloride	ND		ug/kg	2.5	0.57	1
1,2-Dichloropropane	ND		ug/kg	2.5	0.31	1
Dibromochloromethane	ND		ug/kg	2.5	0.35	1
1,1,2-Trichloroethane	ND		ug/kg	2.5	0.66	1
Tetrachloroethene	ND		ug/kg	1.2	0.48	1
Chlorobenzene	ND		ug/kg	1.2	0.31	1
Trichlorofluoromethane	ND		ug/kg	9.9	1.7	1
1,2-Dichloroethane	ND		ug/kg	2.5	0.64	1
1,1,1-Trichloroethane	ND		ug/kg	1.2	0.41	1
Bromodichloromethane	ND		ug/kg	1.2	0.27	1
trans-1,3-Dichloropropene	ND		ug/kg	2.5	0.68	1
cis-1,3-Dichloropropene	ND		ug/kg	1.2	0.39	1
1,3-Dichloropropene, Total	ND		ug/kg	1.2	0.39	1
1,1-Dichloropropene	ND		ug/kg	1.2	0.39	1
Bromoform	ND		ug/kg	9.9	0.61	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	1.2	0.41	1
Benzene	ND		ug/kg	1.2	0.41	1
Toluene	ND		ug/kg	2.5	1.3	1
Ethylbenzene	ND		ug/kg	2.5	0.35	1
Chloromethane	ND		ug/kg	9.9	2.3	1
Bromomethane	ND		ug/kg	5.0	1.4	1
Vinyl chloride	ND		ug/kg	2.5	0.83	1
Chloroethane	ND		ug/kg	5.0	1.1	1
1,1-Dichloroethene	ND		ug/kg	2.5	0.59	1
trans-1,2-Dichloroethene	ND		ug/kg	3.7	0.34	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-06 Date Collected: 10/16/25 09:40

Client ID: P6SB08_2-3 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	1.2	0.34	1
1,2-Dichlorobenzene	ND		ug/kg	5.0	0.36	1
1,3-Dichlorobenzene	ND		ug/kg	5.0	0.37	1
1,4-Dichlorobenzene	ND		ug/kg	5.0	0.42	1
Methyl tert butyl ether	ND		ug/kg	5.0	0.50	1
p/m-Xylene	ND		ug/kg	5.0	1.4	1
o-Xylene	ND		ug/kg	2.5	0.72	1
Xylenes, Total	ND		ug/kg	2.5	0.72	1
cis-1,2-Dichloroethene	ND		ug/kg	2.5	0.43	1
1,2-Dichloroethene, Total	ND		ug/kg	2.5	0.34	1
Dibromomethane	ND		ug/kg	5.0	0.59	1
Styrene	ND		ug/kg	2.5	0.48	1
Dichlorodifluoromethane	ND		ug/kg	25	2.3	1
Acetone	ND		ug/kg	25	12.	1
Carbon disulfide	ND		ug/kg	25	11.	1
2-Butanone	ND		ug/kg	25	5.5	1
Vinyl acetate	ND		ug/kg	25	5.3	1
4-Methyl-2-pentanone	ND		ug/kg	25	3.2	1
1,2,3-Trichloropropane	ND		ug/kg	5.0	0.31	1
2-Hexanone	ND		ug/kg	25	2.9	1
Bromochloromethane	ND		ug/kg	5.0	0.51	1
2,2-Dichloropropane	ND		ug/kg	5.0	0.50	1
1,2-Dibromoethane	ND		ug/kg	2.5	0.69	1
1,3-Dichloropropane	ND		ug/kg	5.0	0.41	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	1.2	0.33	1
Bromobenzene	ND		ug/kg	5.0	0.36	1
n-Butylbenzene	ND		ug/kg	2.5	0.41	1
sec-Butylbenzene	ND		ug/kg	2.5	0.36	1
tert-Butylbenzene	ND		ug/kg	5.0	0.29	1
o-Chlorotoluene	ND		ug/kg	5.0	0.47	1
p-Chlorotoluene	ND		ug/kg	5.0	0.27	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	7.4	2.5	1
Hexachlorobutadiene	ND		ug/kg	9.9	0.42	1
Isopropylbenzene	ND		ug/kg	2.5	0.27	1
p-Isopropyltoluene	ND		ug/kg	2.5	0.27	1
Naphthalene	ND		ug/kg	9.9	1.6	1
Acrylonitrile	ND		ug/kg	9.9	2.8	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-06 Date Collected: 10/16/25 09:40

Client ID: P6SB08_2-3 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	2.5	0.42	1
1,2,3-Trichlorobenzene	ND		ug/kg	5.0	0.80	1
1,2,4-Trichlorobenzene	ND		ug/kg	5.0	0.67	1
1,3,5-Trimethylbenzene	ND		ug/kg	5.0	0.48	1
1,2,4-Trimethylbenzene	ND		ug/kg	5.0	0.83	1
1,4-Dioxane	ND		ug/kg	200	87.	1
p-Diethylbenzene	ND		ug/kg	5.0	0.44	1
p-Ethyltoluene	ND		ug/kg	5.0	0.95	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	5.0	0.47	1
Ethyl ether	ND		ug/kg	5.0	0.84	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	12	3.5	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**134**	Q	70-130
Toluene-d8	98		70-130
4-Bromofluorobenzene	88		70-130
Dibromofluoromethane	**134**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-07
Client ID: P6SB01_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 13:00
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/29/25 16:30
Analyst: AJK
Percent Solids: 95%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	8.6	3.9	1
1,1-Dichloroethane	ND		ug/kg	1.7	0.25	1
Chloroform	0.34	J	ug/kg	2.6	0.24	1
Carbon tetrachloride	ND		ug/kg	1.7	0.40	1
1,2-Dichloropropane	ND		ug/kg	1.7	0.21	1
Dibromochloromethane	ND		ug/kg	1.7	0.24	1
1,1,2-Trichloroethane	ND		ug/kg	1.7	0.46	1
Tetrachloroethene	ND		ug/kg	0.86	0.34	1
Chlorobenzene	ND		ug/kg	0.86	0.22	1
Trichlorofluoromethane	ND		ug/kg	6.9	1.2	1
1,2-Dichloroethane	ND		ug/kg	1.7	0.44	1
1,1,1-Trichloroethane	ND		ug/kg	0.86	0.29	1
Bromodichloromethane	ND		ug/kg	0.86	0.19	1
trans-1,3-Dichloropropene	ND		ug/kg	1.7	0.47	1
cis-1,3-Dichloropropene	ND		ug/kg	0.86	0.27	1
1,3-Dichloropropene, Total	ND		ug/kg	0.86	0.27	1
1,1-Dichloropropene	ND		ug/kg	0.86	0.27	1
Bromoform	ND		ug/kg	6.9	0.42	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.86	0.28	1
Benzene	ND		ug/kg	0.86	0.28	1
Toluene	ND		ug/kg	1.7	0.93	1
Ethylbenzene	ND		ug/kg	1.7	0.24	1
Chloromethane	ND		ug/kg	6.9	1.6	1
Bromomethane	ND		ug/kg	3.4	1.0	1
Vinyl chloride	ND		ug/kg	1.7	0.58	1
Chloroethane	ND		ug/kg	3.4	0.78	1
1,1-Dichloroethene	ND		ug/kg	1.7	0.41	1
trans-1,2-Dichloroethene	ND		ug/kg	2.6	0.24	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-07 Date Collected: 10/16/25 13:00

Client ID: P6SB01_0-1 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.86	0.24	1
1,2-Dichlorobenzene	ND		ug/kg	3.4	0.25	1
1,3-Dichlorobenzene	ND		ug/kg	3.4	0.25	1
1,4-Dichlorobenzene	ND		ug/kg	3.4	0.29	1
Methyl tert butyl ether	ND		ug/kg	3.4	0.34	1
p/m-Xylene	ND		ug/kg	3.4	0.96	1
o-Xylene	ND		ug/kg	1.7	0.50	1
Xylenes, Total	ND		ug/kg	1.7	0.50	1
cis-1,2-Dichloroethene	ND		ug/kg	1.7	0.30	1
1,2-Dichloroethene, Total	ND		ug/kg	1.7	0.24	1
Dibromomethane	ND		ug/kg	3.4	0.41	1
Styrene	ND		ug/kg	1.7	0.34	1
Dichlorodifluoromethane	ND		ug/kg	17	1.6	1
Acetone	ND		ug/kg	17	8.3	1
Carbon disulfide	ND		ug/kg	17	7.8	1
2-Butanone	ND		ug/kg	17	3.8	1
Vinyl acetate	ND		ug/kg	17	3.7	1
4-Methyl-2-pentanone	ND		ug/kg	17	2.2	1
1,2,3-Trichloropropane	ND		ug/kg	3.4	0.22	1
2-Hexanone	ND		ug/kg	17	2.0	1
Bromochloromethane	ND		ug/kg	3.4	0.35	1
2,2-Dichloropropane	ND		ug/kg	3.4	0.35	1
1,2-Dibromoethane	ND		ug/kg	1.7	0.48	1
1,3-Dichloropropane	ND		ug/kg	3.4	0.29	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.86	0.23	1
Bromobenzene	ND		ug/kg	3.4	0.25	1
n-Butylbenzene	ND		ug/kg	1.7	0.29	1
sec-Butylbenzene	ND		ug/kg	1.7	0.25	1
tert-Butylbenzene	ND		ug/kg	3.4	0.20	1
o-Chlorotoluene	ND		ug/kg	3.4	0.33	1
p-Chlorotoluene	ND		ug/kg	3.4	0.18	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	5.2	1.7	1
Hexachlorobutadiene	ND		ug/kg	6.9	0.29	1
Isopropylbenzene	ND		ug/kg	1.7	0.19	1
p-Isopropyltoluene	ND		ug/kg	1.7	0.19	1
Naphthalene	ND		ug/kg	6.9	1.1	1
Acrylonitrile	ND		ug/kg	6.9	2.0	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-07 Date Collected: 10/16/25 13:00

Client ID: P6SB01_0-1 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.7	0.29	1
1,2,3-Trichlorobenzene	ND		ug/kg	3.4	0.55	1
1,2,4-Trichlorobenzene	ND		ug/kg	3.4	0.47	1
1,3,5-Trimethylbenzene	ND		ug/kg	3.4	0.33	1
1,2,4-Trimethylbenzene	ND		ug/kg	3.4	0.57	1
1,4-Dioxane	ND		ug/kg	140	60.	1
p-Diethylbenzene	ND		ug/kg	3.4	0.30	1
p-Ethyltoluene	ND		ug/kg	3.4	0.66	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	3.4	0.33	1
Ethyl ether	ND		ug/kg	3.4	0.58	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	8.6	2.4	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**137**	Q	70-130
Toluene-d8	96		70-130
4-Bromofluorobenzene	87		70-130
Dibromofluoromethane	**136**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-08
Client ID: P6SB01_5-6
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 13:45
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/29/25 16:57
Analyst: AJK
Percent Solids: 84%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	5.0	2.3	1
1,1-Dichloroethane	ND		ug/kg	1.0	0.14	1
Chloroform	0.28	J	ug/kg	1.5	0.14	1
Carbon tetrachloride	ND		ug/kg	1.0	0.23	1
1,2-Dichloropropane	ND		ug/kg	1.0	0.12	1
Dibromochloromethane	ND		ug/kg	1.0	0.14	1
1,1,2-Trichloroethane	ND		ug/kg	1.0	0.27	1
Tetrachloroethene	ND		ug/kg	0.50	0.20	1
Chlorobenzene	ND		ug/kg	0.50	0.13	1
Trichlorofluoromethane	ND		ug/kg	4.0	0.69	1
1,2-Dichloroethane	ND		ug/kg	1.0	0.26	1
1,1,1-Trichloroethane	ND		ug/kg	0.50	0.17	1
Bromodichloromethane	ND		ug/kg	0.50	0.11	1
trans-1,3-Dichloropropene	ND		ug/kg	1.0	0.27	1
cis-1,3-Dichloropropene	ND		ug/kg	0.50	0.16	1
1,3-Dichloropropene, Total	ND		ug/kg	0.50	0.16	1
1,1-Dichloropropene	ND		ug/kg	0.50	0.16	1
Bromoform	ND		ug/kg	4.0	0.24	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.50	0.16	1
Benzene	ND		ug/kg	0.50	0.16	1
Toluene	ND		ug/kg	1.0	0.54	1
Ethylbenzene	ND		ug/kg	1.0	0.14	1
Chloromethane	ND		ug/kg	4.0	0.93	1
Bromomethane	ND		ug/kg	2.0	0.58	1
Vinyl chloride	ND		ug/kg	1.0	0.33	1
Chloroethane	ND		ug/kg	2.0	0.45	1
1,1-Dichloroethene	ND		ug/kg	1.0	0.24	1
trans-1,2-Dichloroethene	ND		ug/kg	1.5	0.14	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-08 Date Collected: 10/16/25 13:45

Client ID: P6SB01_5-6 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.50	0.14	1
1,2-Dichlorobenzene	ND		ug/kg	2.0	0.14	1
1,3-Dichlorobenzene	ND		ug/kg	2.0	0.15	1
1,4-Dichlorobenzene	ND		ug/kg	2.0	0.17	1
Methyl tert butyl ether	ND		ug/kg	2.0	0.20	1
p/m-Xylene	ND		ug/kg	2.0	0.56	1
o-Xylene	ND		ug/kg	1.0	0.29	1
Xylenes, Total	ND		ug/kg	1.0	0.29	1
cis-1,2-Dichloroethene	ND		ug/kg	1.0	0.17	1
1,2-Dichloroethene, Total	ND		ug/kg	1.0	0.14	1
Dibromomethane	ND		ug/kg	2.0	0.24	1
Styrene	ND		ug/kg	1.0	0.20	1
Dichlorodifluoromethane	ND		ug/kg	10	0.91	1
Acetone	ND		ug/kg	10	4.8	1
Carbon disulfide	ND		ug/kg	10	4.5	1
2-Butanone	ND		ug/kg	10	2.2	1
Vinyl acetate	ND		ug/kg	10	2.1	1
4-Methyl-2-pentanone	ND		ug/kg	10	1.3	1
1,2,3-Trichloropropane	ND		ug/kg	2.0	0.13	1
2-Hexanone	ND		ug/kg	10	1.2	1
Bromochloromethane	ND		ug/kg	2.0	0.20	1
2,2-Dichloropropane	ND		ug/kg	2.0	0.20	1
1,2-Dibromoethane	ND		ug/kg	1.0	0.28	1
1,3-Dichloropropane	ND		ug/kg	2.0	0.17	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.50	0.13	1
Bromobenzene	ND		ug/kg	2.0	0.14	1
n-Butylbenzene	ND		ug/kg	1.0	0.17	1
sec-Butylbenzene	ND		ug/kg	1.0	0.14	1
tert-Butylbenzene	ND		ug/kg	2.0	0.12	1
o-Chlorotoluene	ND		ug/kg	2.0	0.19	1
p-Chlorotoluene	ND		ug/kg	2.0	0.11	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	3.0	1.0	1
Hexachlorobutadiene	ND		ug/kg	4.0	0.17	1
Isopropylbenzene	ND		ug/kg	1.0	0.11	1
p-Isopropyltoluene	ND		ug/kg	1.0	0.11	1
Naphthalene	ND		ug/kg	4.0	0.65	1
Acrylonitrile	ND		ug/kg	4.0	1.1	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-08 Date Collected: 10/16/25 13:45

Client ID: P6SB01_5-6 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.0	0.17	1
1,2,3-Trichlorobenzene	ND		ug/kg	2.0	0.32	1
1,2,4-Trichlorobenzene	ND		ug/kg	2.0	0.27	1
1,3,5-Trimethylbenzene	ND		ug/kg	2.0	0.19	1
1,2,4-Trimethylbenzene	ND		ug/kg	2.0	0.33	1
1,4-Dioxane	ND		ug/kg	80	35.	1
p-Diethylbenzene	ND		ug/kg	2.0	0.18	1
p-Ethyltoluene	ND		ug/kg	2.0	0.38	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	2.0	0.19	1
Ethyl ether	ND		ug/kg	2.0	0.34	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	5.0	1.4	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**139**	Q	70-130
Toluene-d8	95		70-130
4-Bromofluorobenzene	90		70-130
Dibromofluoromethane	**136**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-09
Client ID: P6SB05_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 14:05
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/29/25 17:24
Analyst: AJK
Percent Solids: 92%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	9.8	4.5	1
1,1-Dichloroethane	ND		ug/kg	2.0	0.28	1
Chloroform	0.46	J	ug/kg	2.9	0.27	1
Carbon tetrachloride	ND		ug/kg	2.0	0.45	1
1,2-Dichloropropane	ND		ug/kg	2.0	0.24	1
Dibromochloromethane	ND		ug/kg	2.0	0.27	1
1,1,2-Trichloroethane	ND		ug/kg	2.0	0.52	1
Tetrachloroethene	ND		ug/kg	0.98	0.38	1
Chlorobenzene	ND		ug/kg	0.98	0.25	1
Trichlorofluoromethane	ND		ug/kg	7.8	1.4	1
1,2-Dichloroethane	ND		ug/kg	2.0	0.50	1
1,1,1-Trichloroethane	ND		ug/kg	0.98	0.33	1
Bromodichloromethane	ND		ug/kg	0.98	0.21	1
trans-1,3-Dichloropropene	ND		ug/kg	2.0	0.53	1
cis-1,3-Dichloropropene	ND		ug/kg	0.98	0.31	1
1,3-Dichloropropene, Total	ND		ug/kg	0.98	0.31	1
1,1-Dichloropropene	ND		ug/kg	0.98	0.31	1
Bromoform	ND		ug/kg	7.8	0.48	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.98	0.32	1
Benzene	ND		ug/kg	0.98	0.32	1
Toluene	ND		ug/kg	2.0	1.1	1
Ethylbenzene	ND		ug/kg	2.0	0.28	1
Chloromethane	ND		ug/kg	7.8	1.8	1
Bromomethane	ND		ug/kg	3.9	1.1	1
Vinyl chloride	ND		ug/kg	2.0	0.65	1
Chloroethane	ND		ug/kg	3.9	0.88	1
1,1-Dichloroethene	ND		ug/kg	2.0	0.46	1
trans-1,2-Dichloroethene	ND		ug/kg	2.9	0.27	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-09 Date Collected: 10/16/25 14:05

Client ID: P6SB05_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.98	0.27	1
1,2-Dichlorobenzene	ND		ug/kg	3.9	0.28	1
1,3-Dichlorobenzene	ND		ug/kg	3.9	0.29	1
1,4-Dichlorobenzene	ND		ug/kg	3.9	0.33	1
Methyl tert butyl ether	ND		ug/kg	3.9	0.39	1
p/m-Xylene	ND		ug/kg	3.9	1.1	1
o-Xylene	ND		ug/kg	2.0	0.57	1
Xylenes, Total	ND		ug/kg	2.0	0.57	1
cis-1,2-Dichloroethene	ND		ug/kg	2.0	0.34	1
1,2-Dichloroethene, Total	ND		ug/kg	2.0	0.27	1
Dibromomethane	ND		ug/kg	3.9	0.46	1
Styrene	ND		ug/kg	2.0	0.38	1
Dichlorodifluoromethane	ND		ug/kg	20	1.8	1
Acetone	ND		ug/kg	20	9.4	1
Carbon disulfide	ND		ug/kg	20	8.9	1
2-Butanone	ND		ug/kg	20	4.3	1
Vinyl acetate	ND		ug/kg	20	4.2	1
4-Methyl-2-pentanone	ND		ug/kg	20	2.5	1
1,2,3-Trichloropropane	ND		ug/kg	3.9	0.25	1
2-Hexanone	ND		ug/kg	20	2.3	1
Bromochloromethane	ND		ug/kg	3.9	0.40	1
2,2-Dichloropropane	ND		ug/kg	3.9	0.39	1
1,2-Dibromoethane	ND		ug/kg	2.0	0.54	1
1,3-Dichloropropane	ND		ug/kg	3.9	0.33	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.98	0.26	1
Bromobenzene	ND		ug/kg	3.9	0.28	1
n-Butylbenzene	ND		ug/kg	2.0	0.33	1
sec-Butylbenzene	ND		ug/kg	2.0	0.28	1
tert-Butylbenzene	ND		ug/kg	3.9	0.23	1
o-Chlorotoluene	ND		ug/kg	3.9	0.37	1
p-Chlorotoluene	ND		ug/kg	3.9	0.21	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	5.8	1.9	1
Hexachlorobutadiene	ND		ug/kg	7.8	0.33	1
Isopropylbenzene	ND		ug/kg	2.0	0.21	1
p-Isopropyltoluene	ND		ug/kg	2.0	0.21	1
Naphthalene	ND		ug/kg	7.8	1.3	1
Acrylonitrile	ND		ug/kg	7.8	2.2	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-09 Date Collected: 10/16/25 14:05

Client ID: P6SB05_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	2.0	0.33	1
1,2,3-Trichlorobenzene	ND		ug/kg	3.9	0.63	1
1,2,4-Trichlorobenzene	ND		ug/kg	3.9	0.53	1
1,3,5-Trimethylbenzene	ND		ug/kg	3.9	0.38	1
1,2,4-Trimethylbenzene	ND		ug/kg	3.9	0.65	1
1,4-Dioxane	ND		ug/kg	160	68.	1
p-Diethylbenzene	ND		ug/kg	3.9	0.34	1
p-Ethyltoluene	ND		ug/kg	3.9	0.75	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	3.9	0.37	1
Ethyl ether	ND		ug/kg	3.9	0.66	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	9.8	2.8	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**136**	Q	70-130
Toluene-d8	95		70-130
4-Bromofluorobenzene	88		70-130
Dibromofluoromethane	**136**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-10
Client ID: P6SB05_5-6
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 14:30
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/29/25 17:51
Analyst: AJK
Percent Solids: 84%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	4.6	2.1	1
1,1-Dichloroethane	ND		ug/kg	0.93	0.13	1
Chloroform	ND		ug/kg	1.4	0.13	1
Carbon tetrachloride	ND		ug/kg	0.93	0.21	1
1,2-Dichloropropane	ND		ug/kg	0.93	0.12	1
Dibromochloromethane	ND		ug/kg	0.93	0.13	1
1,1,2-Trichloroethane	ND		ug/kg	0.93	0.25	1
Tetrachloroethene	ND		ug/kg	0.46	0.18	1
Chlorobenzene	ND		ug/kg	0.46	0.12	1
Trichlorofluoromethane	ND		ug/kg	3.7	0.64	1
1,2-Dichloroethane	ND		ug/kg	0.93	0.24	1
1,1,1-Trichloroethane	ND		ug/kg	0.46	0.16	1
Bromodichloromethane	ND		ug/kg	0.46	0.10	1
trans-1,3-Dichloropropene	ND		ug/kg	0.93	0.25	1
cis-1,3-Dichloropropene	ND		ug/kg	0.46	0.15	1
1,3-Dichloropropene, Total	ND		ug/kg	0.46	0.15	1
1,1-Dichloropropene	ND		ug/kg	0.46	0.15	1
Bromoform	ND		ug/kg	3.7	0.23	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.46	0.15	1
Benzene	ND		ug/kg	0.46	0.15	1
Toluene	ND		ug/kg	0.93	0.50	1
Ethylbenzene	ND		ug/kg	0.93	0.13	1
Chloromethane	ND		ug/kg	3.7	0.86	1
Bromomethane	ND		ug/kg	1.8	0.54	1
Vinyl chloride	ND		ug/kg	0.93	0.31	1
Chloroethane	ND		ug/kg	1.8	0.42	1
1,1-Dichloroethene	ND		ug/kg	0.93	0.22	1
trans-1,2-Dichloroethene	ND		ug/kg	1.4	0.13	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-10 Date Collected: 10/16/25 14:30

Client ID: P6SB05_5-6 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.46	0.13	1
1,2-Dichlorobenzene	ND		ug/kg	1.8	0.13	1
1,3-Dichlorobenzene	ND		ug/kg	1.8	0.14	1
1,4-Dichlorobenzene	ND		ug/kg	1.8	0.16	1
Methyl tert butyl ether	ND		ug/kg	1.8	0.19	1
p/m-Xylene	ND		ug/kg	1.8	0.52	1
o-Xylene	ND		ug/kg	0.93	0.27	1
Xylenes, Total	ND		ug/kg	0.93	0.27	1
cis-1,2-Dichloroethene	ND		ug/kg	0.93	0.16	1
1,2-Dichloroethene, Total	ND		ug/kg	0.93	0.13	1
Dibromomethane	ND		ug/kg	1.8	0.22	1
Styrene	ND		ug/kg	0.93	0.18	1
Dichlorodifluoromethane	ND		ug/kg	9.3	0.85	1
Acetone	9.3		ug/kg	9.3	4.5	1
Carbon disulfide	ND		ug/kg	9.3	4.2	1
2-Butanone	ND		ug/kg	9.3	2.1	1
Vinyl acetate	ND		ug/kg	9.3	2.0	1
4-Methyl-2-pentanone	ND		ug/kg	9.3	1.2	1
1,2,3-Trichloropropane	ND		ug/kg	1.8	0.12	1
2-Hexanone	ND		ug/kg	9.3	1.1	1
Bromochloromethane	ND		ug/kg	1.8	0.19	1
2,2-Dichloropropane	ND		ug/kg	1.8	0.19	1
1,2-Dibromoethane	ND		ug/kg	0.93	0.26	1
1,3-Dichloropropane	ND		ug/kg	1.8	0.16	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.46	0.12	1
Bromobenzene	ND		ug/kg	1.8	0.13	1
n-Butylbenzene	ND		ug/kg	0.93	0.16	1
sec-Butylbenzene	ND		ug/kg	0.93	0.14	1
tert-Butylbenzene	ND		ug/kg	1.8	0.11	1
o-Chlorotoluene	ND		ug/kg	1.8	0.18	1
p-Chlorotoluene	ND		ug/kg	1.8	0.10	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	2.8	0.93	1
Hexachlorobutadiene	ND		ug/kg	3.7	0.16	1
Isopropylbenzene	ND		ug/kg	0.93	0.10	1
p-Isopropyltoluene	ND		ug/kg	0.93	0.10	1
Naphthalene	ND		ug/kg	3.7	0.60	1
Acrylonitrile	ND		ug/kg	3.7	1.1	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-10 Date Collected: 10/16/25 14:30

Client ID: P6SB05_5-6 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	0.93	0.16	1
1,2,3-Trichlorobenzene	ND		ug/kg	1.8	0.30	1
1,2,4-Trichlorobenzene	ND		ug/kg	1.8	0.25	1
1,3,5-Trimethylbenzene	ND		ug/kg	1.8	0.18	1
1,2,4-Trimethylbenzene	ND		ug/kg	1.8	0.31	1
1,4-Dioxane	ND		ug/kg	74	32.	1
p-Diethylbenzene	ND		ug/kg	1.8	0.16	1
p-Ethyltoluene	ND		ug/kg	1.8	0.36	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	1.8	0.18	1
Ethyl ether	ND		ug/kg	1.8	0.32	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	4.6	1.3	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**235**	Q	70-130
Toluene-d8	86		70-130
4-Bromofluorobenzene	83		70-130
Dibromofluoromethane	**194**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-10 R
Client ID: P6SB05_5-6
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 14:30
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8260D
Analytical Date: 10/30/25 09:35
Analyst: MNF
Percent Solids: 84%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Methylene chloride	ND		ug/kg	5.2	2.4	1
1,1-Dichloroethane	ND		ug/kg	1.0	0.15	1
Chloroform	ND		ug/kg	1.5	0.14	1
Carbon tetrachloride	ND		ug/kg	1.0	0.24	1
1,2-Dichloropropane	ND		ug/kg	1.0	0.13	1
Dibromochloromethane	ND		ug/kg	1.0	0.14	1
1,1,2-Trichloroethane	ND		ug/kg	1.0	0.28	1
Tetrachloroethene	ND		ug/kg	0.52	0.20	1
Chlorobenzene	ND		ug/kg	0.52	0.13	1
Trichlorofluoromethane	ND		ug/kg	4.1	0.72	1
1,2-Dichloroethane	ND		ug/kg	1.0	0.26	1
1,1,1-Trichloroethane	ND		ug/kg	0.52	0.17	1
Bromodichloromethane	ND		ug/kg	0.52	0.11	1
trans-1,3-Dichloropropene	ND		ug/kg	1.0	0.28	1
cis-1,3-Dichloropropene	ND		ug/kg	0.52	0.16	1
1,3-Dichloropropene, Total	ND		ug/kg	0.52	0.16	1
1,1-Dichloropropene	ND		ug/kg	0.52	0.16	1
Bromoform	ND		ug/kg	4.1	0.25	1
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.52	0.17	1
Benzene	ND		ug/kg	0.52	0.17	1
Toluene	ND		ug/kg	1.0	0.56	1
Ethylbenzene	ND		ug/kg	1.0	0.14	1
Chloromethane	ND		ug/kg	4.1	0.96	1
Bromomethane	0.81	J	ug/kg	2.1	0.60	1
Vinyl chloride	ND		ug/kg	1.0	0.35	1
Chloroethane	ND		ug/kg	2.1	0.47	1
1,1-Dichloroethene	ND		ug/kg	1.0	0.24	1
trans-1,2-Dichloroethene	ND		ug/kg	1.5	0.14	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-10 R Date Collected: 10/16/25 14:30

Client ID: P6SB05_5-6 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
Trichloroethene	ND		ug/kg	0.52	0.14	1
1,2-Dichlorobenzene	ND		ug/kg	2.1	0.15	1
1,3-Dichlorobenzene	ND		ug/kg	2.1	0.15	1
1,4-Dichlorobenzene	ND		ug/kg	2.1	0.18	1
Methyl tert butyl ether	ND		ug/kg	2.1	0.21	1
p/m-Xylene	ND		ug/kg	2.1	0.58	1
o-Xylene	ND		ug/kg	1.0	0.30	1
Xylenes, Total	ND		ug/kg	1.0	0.30	1
cis-1,2-Dichloroethene	ND		ug/kg	1.0	0.18	1
1,2-Dichloroethene, Total	ND		ug/kg	1.0	0.14	1
Dibromomethane	ND		ug/kg	2.1	0.24	1
Styrene	ND		ug/kg	1.0	0.20	1
Dichlorodifluoromethane	ND		ug/kg	10	0.94	1
Acetone	ND		ug/kg	10	5.0	1
Carbon disulfide	ND		ug/kg	10	4.7	1
2-Butanone	ND		ug/kg	10	2.3	1
Vinyl acetate	ND		ug/kg	10	2.2	1
4-Methyl-2-pentanone	ND		ug/kg	10	1.3	1
1,2,3-Trichloropropane	ND		ug/kg	2.1	0.13	1
2-Hexanone	ND		ug/kg	10	1.2	1
Bromochloromethane	ND		ug/kg	2.1	0.21	1
2,2-Dichloropropane	ND		ug/kg	2.1	0.21	1
1,2-Dibromoethane	ND		ug/kg	1.0	0.29	1
1,3-Dichloropropane	ND		ug/kg	2.1	0.17	1
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.52	0.14	1
Bromobenzene	ND		ug/kg	2.1	0.15	1
n-Butylbenzene	ND		ug/kg	1.0	0.17	1
sec-Butylbenzene	ND		ug/kg	1.0	0.15	1
tert-Butylbenzene	ND		ug/kg	2.1	0.12	1
o-Chlorotoluene	ND		ug/kg	2.1	0.20	1
p-Chlorotoluene	ND		ug/kg	2.1	0.11	1
1,2-Dibromo-3-chloropropane	ND		ug/kg	3.1	1.0	1
Hexachlorobutadiene	ND		ug/kg	4.1	0.17	1
Isopropylbenzene	ND		ug/kg	1.0	0.11	1
p-Isopropyltoluene	ND		ug/kg	1.0	0.11	1
Naphthalene	ND		ug/kg	4.1	0.67	1
Acrylonitrile	ND		ug/kg	4.1	1.2	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-10 R Date Collected: 10/16/25 14:30

Client ID: P6SB05_5-6 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by EPA 5035 Low - Westborough Lab						
n-Propylbenzene	ND		ug/kg	1.0	0.18	1
1,2,3-Trichlorobenzene	ND		ug/kg	2.1	0.33	1
1,2,4-Trichlorobenzene	ND		ug/kg	2.1	0.28	1
1,3,5-Trimethylbenzene	ND		ug/kg	2.1	0.20	1
1,2,4-Trimethylbenzene	ND		ug/kg	2.1	0.34	1
1,4-Dioxane	ND		ug/kg	83	36.	1
p-Diethylbenzene	ND		ug/kg	2.1	0.18	1
p-Ethyltoluene	ND		ug/kg	2.1	0.40	1
1,2,4,5-Tetramethylbenzene	ND		ug/kg	2.1	0.20	1
Ethyl ether	ND		ug/kg	2.1	0.35	1
trans-1,4-Dichloro-2-butene	ND		ug/kg	5.2	1.5	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	**184**	Q	70-130
Toluene-d8	87		70-130
4-Bromofluorobenzene	89		70-130
Dibromofluoromethane	**157**	Q	70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/29/25 09:12
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 01-10 Batch: WG2134890-5					
Methylene chloride	ND		ug/kg	5.0	2.3
1,1-Dichloroethane	ND		ug/kg	1.0	0.14
Chloroform	0.81	J	ug/kg	1.5	0.14
Carbon tetrachloride	ND		ug/kg	1.0	0.23
1,2-Dichloropropane	ND		ug/kg	1.0	0.12
Dibromochloromethane	ND		ug/kg	1.0	0.14
1,1,2-Trichloroethane	ND		ug/kg	1.0	0.27
Tetrachloroethene	ND		ug/kg	0.50	0.20
Chlorobenzene	ND		ug/kg	0.50	0.13
Trichlorofluoromethane	ND		ug/kg	4.0	0.70
1,2-Dichloroethane	ND		ug/kg	1.0	0.26
1,1,1-Trichloroethane	ND		ug/kg	0.50	0.17
Bromodichloromethane	ND		ug/kg	0.50	0.11
trans-1,3-Dichloropropene	ND		ug/kg	1.0	0.27
cis-1,3-Dichloropropene	ND		ug/kg	0.50	0.16
1,3-Dichloropropene, Total	ND		ug/kg	0.50	0.16
1,1-Dichloropropene	ND		ug/kg	0.50	0.16
Bromoform	ND		ug/kg	4.0	0.25
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.50	0.17
Benzene	ND		ug/kg	0.50	0.17
Toluene	ND		ug/kg	1.0	0.54
Ethylbenzene	ND		ug/kg	1.0	0.14
Chloromethane	ND		ug/kg	4.0	0.93
Bromomethane	ND		ug/kg	2.0	0.58

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/29/25 09:12
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 01-10 Batch: WG2134890-5					
Vinyl chloride	ND		ug/kg	1.0	0.34
Chloroethane	ND		ug/kg	2.0	0.45
1,1-Dichloroethene	ND		ug/kg	1.0	0.24
trans-1,2-Dichloroethene	ND		ug/kg	1.5	0.14
Trichloroethene	ND		ug/kg	0.50	0.14
1,2-Dichlorobenzene	ND		ug/kg	2.0	0.14
1,3-Dichlorobenzene	ND		ug/kg	2.0	0.15
1,4-Dichlorobenzene	ND		ug/kg	2.0	0.17
Methyl tert butyl ether	ND		ug/kg	2.0	0.20
p/m-Xylene	ND		ug/kg	2.0	0.56
o-Xylene	ND		ug/kg	1.0	0.29
Xylenes, Total	ND		ug/kg	1.0	0.29
cis-1,2-Dichloroethene	ND		ug/kg	1.0	0.18
1,2-Dichloroethene, Total	ND		ug/kg	1.0	0.14
Dibromomethane	ND		ug/kg	2.0	0.24
Styrene	ND		ug/kg	1.0	0.20
Dichlorodifluoromethane	ND		ug/kg	10	0.92
Acetone	ND		ug/kg	10	4.8
Carbon disulfide	ND		ug/kg	10	4.6
2-Butanone	ND		ug/kg	10	2.2
Vinyl acetate	ND		ug/kg	10	2.2
4-Methyl-2-pentanone	ND		ug/kg	10	1.3
1,2,3-Trichloropropane	ND		ug/kg	2.0	0.13
2-Hexanone	ND		ug/kg	10	1.2

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/29/25 09:12
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 01-10 Batch: WG2134890-5					
Bromochloromethane	ND		ug/kg	2.0	0.20
2,2-Dichloropropane	ND		ug/kg	2.0	0.20
1,2-Dibromoethane	ND		ug/kg	1.0	0.28
1,3-Dichloropropane	ND		ug/kg	2.0	0.17
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.50	0.13
Bromobenzene	ND		ug/kg	2.0	0.14
n-Butylbenzene	ND		ug/kg	1.0	0.17
sec-Butylbenzene	ND		ug/kg	1.0	0.15
tert-Butylbenzene	ND		ug/kg	2.0	0.12
o-Chlorotoluene	ND		ug/kg	2.0	0.19
p-Chlorotoluene	ND		ug/kg	2.0	0.11
1,2-Dibromo-3-chloropropane	ND		ug/kg	3.0	1.0
Hexachlorobutadiene	ND		ug/kg	4.0	0.17
Isopropylbenzene	ND		ug/kg	1.0	0.11
p-Isopropyltoluene	ND		ug/kg	1.0	0.11
Naphthalene	ND		ug/kg	4.0	0.65
Acrylonitrile	ND		ug/kg	4.0	1.2
n-Propylbenzene	ND		ug/kg	1.0	0.17
1,2,3-Trichlorobenzene	ND		ug/kg	2.0	0.32
1,2,4-Trichlorobenzene	ND		ug/kg	2.0	0.27
1,3,5-Trimethylbenzene	ND		ug/kg	2.0	0.19
1,2,4-Trimethylbenzene	ND		ug/kg	2.0	0.33
1,4-Dioxane	ND		ug/kg	80	35.
p-Diethylbenzene	ND		ug/kg	2.0	0.18

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/29/25 09:12
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 01-10 Batch: WG2134890-5					
p-Ethyltoluene	ND		ug/kg	2.0	0.38
1,2,4,5-Tetramethylbenzene	ND		ug/kg	2.0	0.19
Ethyl ether	ND		ug/kg	2.0	0.34
trans-1,4-Dichloro-2-butene	ND		ug/kg	5.0	1.4

Surrogate	%Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	121		70-130
Toluene-d8	95		70-130
4-Bromofluorobenzene	86		70-130
Dibromofluoromethane	126		70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/30/25 09:08
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 10 Batch: WG2135009-5					
Methylene chloride	ND		ug/kg	5.0	2.3
1,1-Dichloroethane	ND		ug/kg	1.0	0.14
Chloroform	0.90	J	ug/kg	1.5	0.14
Carbon tetrachloride	ND		ug/kg	1.0	0.23
1,2-Dichloropropane	ND		ug/kg	1.0	0.12
Dibromochloromethane	ND		ug/kg	1.0	0.14
1,1,2-Trichloroethane	ND		ug/kg	1.0	0.27
Tetrachloroethene	ND		ug/kg	0.50	0.20
Chlorobenzene	ND		ug/kg	0.50	0.13
Trichlorofluoromethane	ND		ug/kg	4.0	0.70
1,2-Dichloroethane	ND		ug/kg	1.0	0.26
1,1,1-Trichloroethane	ND		ug/kg	0.50	0.17
Bromodichloromethane	ND		ug/kg	0.50	0.11
trans-1,3-Dichloropropene	ND		ug/kg	1.0	0.27
cis-1,3-Dichloropropene	ND		ug/kg	0.50	0.16
1,3-Dichloropropene, Total	ND		ug/kg	0.50	0.16
1,1-Dichloropropene	ND		ug/kg	0.50	0.16
Bromoform	ND		ug/kg	4.0	0.25
1,1,2,2-Tetrachloroethane	ND		ug/kg	0.50	0.17
Benzene	ND		ug/kg	0.50	0.17
Toluene	ND		ug/kg	1.0	0.54
Ethylbenzene	ND		ug/kg	1.0	0.14
Chloromethane	ND		ug/kg	4.0	0.93
Bromomethane	0.72	J	ug/kg	2.0	0.58

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/30/25 09:08
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 10 Batch: WG2135009-5					
Vinyl chloride	ND		ug/kg	1.0	0.34
Chloroethane	ND		ug/kg	2.0	0.45
1,1-Dichloroethene	ND		ug/kg	1.0	0.24
trans-1,2-Dichloroethene	ND		ug/kg	1.5	0.14
Trichloroethene	ND		ug/kg	0.50	0.14
1,2-Dichlorobenzene	ND		ug/kg	2.0	0.14
1,3-Dichlorobenzene	ND		ug/kg	2.0	0.15
1,4-Dichlorobenzene	ND		ug/kg	2.0	0.17
Methyl tert butyl ether	ND		ug/kg	2.0	0.20
p/m-Xylene	ND		ug/kg	2.0	0.56
o-Xylene	ND		ug/kg	1.0	0.29
Xylenes, Total	ND		ug/kg	1.0	0.29
cis-1,2-Dichloroethene	ND		ug/kg	1.0	0.18
1,2-Dichloroethene, Total	ND		ug/kg	1.0	0.14
Dibromomethane	ND		ug/kg	2.0	0.24
Styrene	ND		ug/kg	1.0	0.20
Dichlorodifluoromethane	ND		ug/kg	10	0.92
Acetone	ND		ug/kg	10	4.8
Carbon disulfide	ND		ug/kg	10	4.6
2-Butanone	ND		ug/kg	10	2.2
Vinyl acetate	ND		ug/kg	10	2.2
4-Methyl-2-pentanone	ND		ug/kg	10	1.3
1,2,3-Trichloropropane	ND		ug/kg	2.0	0.13
2-Hexanone	ND		ug/kg	10	1.2

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/30/25 09:08
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 10 Batch: WG2135009-5					
Bromochloromethane	ND		ug/kg	2.0	0.20
2,2-Dichloropropane	ND		ug/kg	2.0	0.20
1,2-Dibromoethane	ND		ug/kg	1.0	0.28
1,3-Dichloropropane	ND		ug/kg	2.0	0.17
1,1,1,2-Tetrachloroethane	ND		ug/kg	0.50	0.13
Bromobenzene	ND		ug/kg	2.0	0.14
n-Butylbenzene	ND		ug/kg	1.0	0.17
sec-Butylbenzene	ND		ug/kg	1.0	0.15
tert-Butylbenzene	ND		ug/kg	2.0	0.12
o-Chlorotoluene	ND		ug/kg	2.0	0.19
p-Chlorotoluene	ND		ug/kg	2.0	0.11
1,2-Dibromo-3-chloropropane	ND		ug/kg	3.0	1.0
Hexachlorobutadiene	ND		ug/kg	4.0	0.17
Isopropylbenzene	ND		ug/kg	1.0	0.11
p-Isopropyltoluene	ND		ug/kg	1.0	0.11
Naphthalene	ND		ug/kg	4.0	0.65
Acrylonitrile	ND		ug/kg	4.0	1.2
n-Propylbenzene	ND		ug/kg	1.0	0.17
1,2,3-Trichlorobenzene	ND		ug/kg	2.0	0.32
1,2,4-Trichlorobenzene	ND		ug/kg	2.0	0.27
1,3,5-Trimethylbenzene	ND		ug/kg	2.0	0.19
1,2,4-Trimethylbenzene	ND		ug/kg	2.0	0.33
1,4-Dioxane	ND		ug/kg	80	35.
p-Diethylbenzene	ND		ug/kg	2.0	0.18

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/30/25 09:08
Analyst: MNF

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by EPA 5035 Low - Westborough Lab for sample(s): 10 Batch: WG2135009-5					
p-Ethyltoluene	ND		ug/kg	2.0	0.38
1,2,4,5-Tetramethylbenzene	ND		ug/kg	2.0	0.19
Ethyl ether	ND		ug/kg	2.0	0.34
trans-1,4-Dichloro-2-butene	ND		ug/kg	5.0	1.4

Surrogate	%Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	120		70-130
Toluene-d8	95		70-130
4-Bromofluorobenzene	88		70-130
Dibromofluoromethane	121		70-130

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 01-10 Batch: WG2134890-3 WG2134890-4								
Methylene chloride	99		91		70-130	8		30
1,1-Dichloroethane	105		98		70-130	7		30
Chloroform	104		97		70-130	7		30
Carbon tetrachloride	126		119		70-130	6		30
1,2-Dichloropropane	100		95		70-130	5		30
Dibromochloromethane	117		115		70-130	2		30
1,1,2-Trichloroethane	111		108		70-130	3		30
Tetrachloroethene	**132**	Q	126		70-130	5		30
Chlorobenzene	108		105		70-130	3		30
Trichlorofluoromethane	97		91		70-139	6		30
1,2-Dichloroethane	108		105		70-130	3		30
1,1,1-Trichloroethane	117		111		70-130	5		30
Bromodichloromethane	109		103		70-130	6		30
trans-1,3-Dichloropropene	110		106		70-130	4		30
cis-1,3-Dichloropropene	98		95		70-130	3		30
1,1-Dichloropropene	103		99		70-130	4		30
Bromoform	110		112		70-130	2		30
1,1,2,2-Tetrachloroethane	100		99		70-130	1		30
Benzene	103		98		70-130	5		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 01-10 Batch: WG2134890-3 WG2134890-4								
Toluene	101		97		70-130	4		30
Ethylbenzene	103		100		70-130	3		30
Chloromethane	102		99		52-130	3		30
Bromomethane	66		60		57-147	10		30
Vinyl chloride	85		83		67-130	2		30
Chloroethane	73		70		50-151	4		30
1,1-Dichloroethene	80		77		65-135	4		30
trans-1,2-Dichloroethene	104		99		70-130	5		30
Trichloroethene	113		108		70-130	5		30
1,2-Dichlorobenzene	107		104		70-130	3		30
1,3-Dichlorobenzene	111		108		70-130	3		30
1,4-Dichlorobenzene	107		104		70-130	3		30
Methyl tert butyl ether	89		86		66-130	3		30
p/m-Xylene	108		103		70-130	5		30
o-Xylene	103		99		70-130	4		30
cis-1,2-Dichloroethene	98		96		70-130	2		30
Dibromomethane	108		102		70-130	6		30
Styrene	107		103		70-130	4		30
Dichlorodifluoromethane	100		95		30-146	5		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 01-10 Batch: WG2134890-3 WG2134890-4								
Acetone	100		96		54-140	4		30
Carbon disulfide	77		73		59-130	5		30
2-Butanone	123		126		70-130	2		30
Vinyl acetate	114		108		70-130	5		30
4-Methyl-2-pentanone	91		87		70-130	4		30
1,2,3-Trichloropropane	102		101		68-130	1		30
2-Hexanone	85		87		70-130	2		30
Bromochloromethane	116		109		70-130	6		30
2,2-Dichloropropane	106		99		70-130	7		30
1,2-Dibromoethane	111		108		70-130	3		30
1,3-Dichloropropane	105		100		69-130	5		30
1,1,1,2-Tetrachloroethane	119		118		70-130	1		30
Bromobenzene	102		100		70-130	2		30
n-Butylbenzene	108		105		70-130	3		30
sec-Butylbenzene	104		103		70-130	1		30
tert-Butylbenzene	99		97		70-130	2		30
o-Chlorotoluene	101		98		70-130	3		30
p-Chlorotoluene	98		97		70-130	1		30
1,2-Dibromo-3-chloropropane	98		100		68-130	2		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 01-10 Batch: WG2134890-3 WG2134890-4								
Hexachlorobutadiene	127		126		67-130	1		30
Isopropylbenzene	91		93		70-130	2		30
p-Isopropyltoluene	101		100		70-130	1		30
Naphthalene	88		90		70-130	2		30
Acrylonitrile	113		108		70-130	5		30
n-Propylbenzene	102		99		70-130	3		30
1,2,3-Trichlorobenzene	107		103		70-130	4		30
1,2,4-Trichlorobenzene	104		103		70-130	1		30
1,3,5-Trimethylbenzene	101		99		70-130	2		30
1,2,4-Trimethylbenzene	100		98		70-130	2		30
1,4-Dioxane	91		90		65-136	1		30
p-Diethylbenzene	100		97		70-130	3		30
p-Ethyltoluene	98		96		70-130	2		30
1,2,4,5-Tetramethylbenzene	91		88		70-130	3		30
Ethyl ether	74		72		67-130	3		30
trans-1,4-Dichloro-2-butene	101		103		70-130	2		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 01-10 Batch: WG2134890-3 WG2134890-4								

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria
1,2-Dichloroethane-d4	110		110		70-130
Toluene-d8	102		99		70-130
4-Bromofluorobenzene	93		85		70-130
Dibromofluoromethane	109		104		70-130

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 10 Batch: WG2135009-3 WG2135009-4								
Methylene chloride	97		95		70-130	2		30
1,1-Dichloroethane	110		107		70-130	3		30
Chloroform	106		103		70-130	3		30
Carbon tetrachloride	**132**	Q	130		70-130	2		30
1,2-Dichloropropane	102		101		70-130	1		30
Dibromochloromethane	116		119		70-130	3		30
1,1,2-Trichloroethane	107		107		70-130	0		30
Tetrachloroethene	**138**	Q	**138**	Q	70-130	0		30
Chlorobenzene	112		114		70-130	2		30
Trichlorofluoromethane	101		98		70-139	3		30
1,2-Dichloroethane	108		106		70-130	2		30
1,1,1-Trichloroethane	124		120		70-130	3		30
Bromodichloromethane	106		106		70-130	0		30
trans-1,3-Dichloropropene	108		110		70-130	2		30
cis-1,3-Dichloropropene	101		100		70-130	1		30
1,1-Dichloropropene	110		109		70-130	1		30
Bromoform	113		116		70-130	3		30
1,1,2,2-Tetrachloroethane	101		99		70-130	2		30
Benzene	108		108		70-130	0		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 10 Batch: WG2135009-3 WG2135009-4								
Toluene	107		108		70-130	1		30
Ethylbenzene	108		110		70-130	2		30
Chloromethane	110		110		52-130	0		30
Bromomethane	67		66		57-147	2		30
Vinyl chloride	92		93		67-130	1		30
Chloroethane	80		79		50-151	1		30
1,1-Dichloroethene	86		86		65-135	0		30
trans-1,2-Dichloroethene	112		110		70-130	2		30
Trichloroethene	117		116		70-130	1		30
1,2-Dichlorobenzene	112		113		70-130	1		30
1,3-Dichlorobenzene	118		116		70-130	2		30
1,4-Dichlorobenzene	111		112		70-130	1		30
Methyl tert butyl ether	89		88		66-130	1		30
p/m-Xylene	110		112		70-130	2		30
o-Xylene	106		108		70-130	2		30
cis-1,2-Dichloroethene	105		106		70-130	1		30
Dibromomethane	103		102		70-130	1		30
Styrene	110		110		70-130	0		30
Dichlorodifluoromethane	107		105		30-146	2		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 10 Batch: WG2135009-3 WG2135009-4								
Acetone	97		96		54-140	1		30
Carbon disulfide	82		80		59-130	2		30
2-Butanone	120		119		70-130	1		30
Vinyl acetate	127		125		70-130	2		30
4-Methyl-2-pentanone	90		88		70-130	2		30
1,2,3-Trichloropropane	101		98		68-130	3		30
2-Hexanone	82		86		70-130	5		30
Bromochloromethane	113		112		70-130	1		30
2,2-Dichloropropane	111		109		70-130	2		30
1,2-Dibromoethane	109		111		70-130	2		30
1,3-Dichloropropane	102		105		69-130	3		30
1,1,1,2-Tetrachloroethane	122		123		70-130	1		30
Bromobenzene	109		108		70-130	1		30
n-Butylbenzene	116		118		70-130	2		30
sec-Butylbenzene	114		114		70-130	0		30
tert-Butylbenzene	109		108		70-130	1		30
o-Chlorotoluene	107		106		70-130	1		30
p-Chlorotoluene	106		104		70-130	2		30
1,2-Dibromo-3-chloropropane	102		102		68-130	0		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 10 Batch: WG2135009-3 WG2135009-4								
Hexachlorobutadiene	**141**	Q	**144**	Q	67-130	2		30
Isopropylbenzene	103		104		70-130	1		30
p-Isopropyltoluene	112		112		70-130	0		30
Naphthalene	93		96		70-130	3		30
Acrylonitrile	106		103		70-130	3		30
n-Propylbenzene	112		108		70-130	4		30
1,2,3-Trichlorobenzene	113		112		70-130	1		30
1,2,4-Trichlorobenzene	113		113		70-130	0		30
1,3,5-Trimethylbenzene	110		108		70-130	2		30
1,2,4-Trimethylbenzene	107		107		70-130	0		30
1,4-Dioxane	98		95		65-136	3		30
p-Diethylbenzene	109		109		70-130	0		30
p-Ethyltoluene	107		106		70-130	1		30
1,2,4,5-Tetramethylbenzene	102		99		70-130	3		30
Ethyl ether	72		74		67-130	3		30
trans-1,4-Dichloro-2-butene	101		99		70-130	2		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by EPA 5035 Low - Westborough Lab Associated sample(s): 10 Batch: WG2135009-3 WG2135009-4								

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria
1,2-Dichloroethane-d4	105		101		70-130
Toluene-d8	98		99		70-130
4-Bromofluorobenzene	94		84		70-130
Dibromofluoromethane	105		103		70-130

SEMIVOLATILES

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-01
Client ID: P6SB02_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 08:15
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/20/25 00:43
Analyst: CMM
Percent Solids: 77%

Extraction Method: EPA 3546
Extraction Date: 10/18/25 07:00

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	300		ug/kg	170	22.	1
1,2,4-Trichlorobenzene	ND		ug/kg	220	25.	1
Hexachlorobenzene	ND		ug/kg	130	24.	1
Bis(2-chloroethyl)ether	ND		ug/kg	190	29.	1
2-Chloronaphthalene	ND		ug/kg	220	21.	1
1,2-Dichlorobenzene	ND		ug/kg	220	39.	1
1,3-Dichlorobenzene	ND		ug/kg	220	37.	1
1,4-Dichlorobenzene	ND		ug/kg	220	38.	1
3,3'-Dichlorobenzidine	ND		ug/kg	220	58.	1
2,4-Dinitrotoluene	ND		ug/kg	220	43.	1
2,6-Dinitrotoluene	ND		ug/kg	220	37.	1
Fluoranthene	20000	E	ug/kg	130	25.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	220	23.	1
4-Bromophenyl phenyl ether	ND		ug/kg	220	33.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	260	37.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	230	22.	1
Hexachlorobutadiene	ND		ug/kg	220	32.	1
Hexachlorocyclopentadiene	ND		ug/kg	620	200	1
Hexachloroethane	ND		ug/kg	170	35.	1
Isophorone	ND		ug/kg	190	28.	1
Naphthalene	460		ug/kg	220	26.	1
Nitrobenzene	ND		ug/kg	190	32.	1
NDPA/DPA	ND		ug/kg	170	25.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	220	33.	1
Bis(2-ethylhexyl)phthalate	ND		ug/kg	220	75.	1
Butyl benzyl phthalate	ND		ug/kg	220	54.	1
Di-n-butylphthalate	ND		ug/kg	220	41.	1
Di-n-octylphthalate	ND		ug/kg	220	74.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-01 Date Collected: 10/16/25 08:15

Client ID: P6SB02_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	220	20.	1
Dimethyl phthalate	ND		ug/kg	220	45.	1
Benzo(a)anthracene	15000	E	ug/kg	130	24.	1
Benzo(a)pyrene	15000	E	ug/kg	170	53.	1
Benzo(b)fluoranthene	18000	E	ug/kg	130	36.	1
Chrysene	11000	E	ug/kg	130	22.	1
Acenaphthylene	2000		ug/kg	170	33.	1
Anthracene	3700		ug/kg	130	42.	1
Benzo(ghi)perylene	3600		ug/kg	170	25.	1
Fluorene	550		ug/kg	220	21.	1
Phenanthrene	6000		ug/kg	130	26.	1
Dibenzo(a,h)anthracene	1800		ug/kg	130	25.	1
Indeno(1,2,3-cd)pyrene	4100		ug/kg	170	30.	1
Pyrene	18000	E	ug/kg	130	22.	1
Biphenyl	44	J	ug/kg	490	28.	1
4-Chloroaniline	ND		ug/kg	220	39.	1
2-Nitroaniline	ND		ug/kg	220	42.	1
3-Nitroaniline	ND		ug/kg	220	41.	1
4-Nitroaniline	ND		ug/kg	220	90.	1
Dibenzofuran	280		ug/kg	220	20.	1
2-Methylnaphthalene	200	J	ug/kg	260	26.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	220	23.	1
Acetophenone	ND		ug/kg	220	27.	1
2,4,6-Trichlorophenol	ND		ug/kg	130	41.	1
p-Chloro-m-cresol	ND		ug/kg	220	32.	1
2-Chlorophenol	ND		ug/kg	220	26.	1
2,4-Dichlorophenol	ND		ug/kg	190	35.	1
2,4-Dimethylphenol	ND		ug/kg	220	71.	1
2-Nitrophenol	ND		ug/kg	470	81.	1
4-Nitrophenol	ND		ug/kg	300	88.	1
2,4-Dinitrophenol	ND		ug/kg	1000	100	1
4,6-Dinitro-o-cresol	ND		ug/kg	560	100	1
Pentachlorophenol	ND		ug/kg	170	48.	1
Phenol	82	J	ug/kg	220	33.	1
2-Methylphenol	57	J	ug/kg	220	34.	1
3-Methylphenol/4-Methylphenol	260	J	ug/kg	310	34.	1
2,4,5-Trichlorophenol	ND		ug/kg	220	41.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-01 Date Collected: 10/16/25 08:15

Client ID: P6SB02_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Benzoic Acid	ND		ug/kg	700	220	1
Benzyl Alcohol	ND		ug/kg	220	66.	1
Carbazole	930		ug/kg	220	21.	1
1,4-Dioxane	ND		ug/kg	32	10.	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	58		25-120
Phenol-d6	56		10-120
Nitrobenzene-d5	58		23-120
2-Fluorobiphenyl	62		30-120
2,4,6-Tribromophenol	86		10-136
4-Terphenyl-d14	54		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-01 D
Client ID: P6SB02_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 08:15
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/23/25 16:09
Analyst: JG
Percent Solids: 77%

Extraction Method: EPA 3546
Extraction Date: 10/18/25 07:00

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Fluoranthene	23000		ug/kg	1300	250	10
Benzo(a)anthracene	14000		ug/kg	1300	240	10
Benzo(a)pyrene	12000		ug/kg	1700	530	10
Benzo(b)fluoranthene	15000		ug/kg	1300	360	10
Benzo(k)fluoranthene	5500		ug/kg	1300	350	10
Chrysene	11000		ug/kg	1300	220	10
Pyrene	19000		ug/kg	1300	220	10

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-02
Client ID: P6SB02_3-4
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 08:45
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/18/25 13:52
Analyst: CMM
Percent Solids: 82%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	ND		ug/kg	160	21.	1
1,2,4-Trichlorobenzene	ND		ug/kg	200	23.	1
Hexachlorobenzene	ND		ug/kg	120	22.	1
Bis(2-chloroethyl)ether	ND		ug/kg	180	27.	1
2-Chloronaphthalene	ND		ug/kg	200	20.	1
1,2-Dichlorobenzene	ND		ug/kg	200	36.	1
1,3-Dichlorobenzene	ND		ug/kg	200	34.	1
1,4-Dichlorobenzene	ND		ug/kg	200	35.	1
3,3'-Dichlorobenzidine	ND		ug/kg	200	53.	1
2,4-Dinitrotoluene	ND		ug/kg	200	40.	1
2,6-Dinitrotoluene	ND		ug/kg	200	34.	1
Fluoranthene	220		ug/kg	120	23.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	200	21.	1
4-Bromophenyl phenyl ether	ND		ug/kg	200	30.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	240	34.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	220	20.	1
Hexachlorobutadiene	ND		ug/kg	200	29.	1
Hexachlorocyclopentadiene	ND		ug/kg	570	180	1
Hexachloroethane	ND		ug/kg	160	32.	1
Isophorone	ND		ug/kg	180	26.	1
Naphthalene	ND		ug/kg	200	24.	1
Nitrobenzene	ND		ug/kg	180	30.	1
NDPA/DPA	ND		ug/kg	160	23.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	200	31.	1
Bis(2-ethylhexyl)phthalate	ND		ug/kg	200	69.	1
Butyl benzyl phthalate	ND		ug/kg	200	50.	1
Di-n-butylphthalate	ND		ug/kg	200	38.	1
Di-n-octylphthalate	ND		ug/kg	200	68.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-02 Date Collected: 10/16/25 08:45

Client ID: P6SB02_3-4 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	200	18.	1
Dimethyl phthalate	ND		ug/kg	200	42.	1
Benzo(a)anthracene	140		ug/kg	120	22.	1
Benzo(a)pyrene	120	J	ug/kg	160	49.	1
Benzo(b)fluoranthene	140		ug/kg	120	34.	1
Benzo(k)fluoranthene	52	J	ug/kg	120	32.	1
Chrysene	120		ug/kg	120	21.	1
Acenaphthylene	55	J	ug/kg	160	31.	1
Anthracene	47	J	ug/kg	120	39.	1
Benzo(ghi)perylene	53	J	ug/kg	160	24.	1
Fluorene	ND		ug/kg	200	19.	1
Phenanthrene	42	J	ug/kg	120	24.	1
Dibenzo(a,h)anthracene	ND		ug/kg	120	23.	1
Indeno(1,2,3-cd)pyrene	60	J	ug/kg	160	28.	1
Pyrene	210		ug/kg	120	20.	1
Biphenyl	ND		ug/kg	460	26.	1
4-Chloroaniline	ND		ug/kg	200	36.	1
2-Nitroaniline	ND		ug/kg	200	39.	1
3-Nitroaniline	ND		ug/kg	200	38.	1
4-Nitroaniline	ND		ug/kg	200	83.	1
Dibenzofuran	ND		ug/kg	200	19.	1
2-Methylnaphthalene	ND		ug/kg	240	24.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	200	21.	1
Acetophenone	ND		ug/kg	200	25.	1
2,4,6-Trichlorophenol	ND		ug/kg	120	38.	1
p-Chloro-m-cresol	ND		ug/kg	200	30.	1
2-Chlorophenol	ND		ug/kg	200	24.	1
2,4-Dichlorophenol	ND		ug/kg	180	32.	1
2,4-Dimethylphenol	ND		ug/kg	200	66.	1
2-Nitrophenol	ND		ug/kg	430	75.	1
4-Nitrophenol	ND		ug/kg	280	82.	1
2,4-Dinitrophenol	ND		ug/kg	960	93.	1
4,6-Dinitro-o-cresol	ND		ug/kg	520	96.	1
Pentachlorophenol	ND		ug/kg	160	44.	1
Phenol	ND		ug/kg	200	30.	1
2-Methylphenol	ND		ug/kg	200	31.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	290	31.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-02 Date Collected: 10/16/25 08:45

Client ID: P6SB02_3-4 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	200	38.	1
Benzoic Acid	ND		ug/kg	650	200	1
Benzyl Alcohol	ND		ug/kg	200	61.	1
Carbazole	ND		ug/kg	200	19.	1
1,4-Dioxane	ND		ug/kg	30	9.2	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	76		25-120
Phenol-d6	70		10-120
Nitrobenzene-d5	80		23-120
2-Fluorobiphenyl	63		30-120
2,4,6-Tribromophenol	69		10-136
4-Terphenyl-d14	63		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-03
Client ID: P6SB09_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 10:30
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/18/25 14:16
Analyst: CMM
Percent Solids: 87%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	84	J	ug/kg	150	19.	1
1,2,4-Trichlorobenzene	ND		ug/kg	190	21.	1
Hexachlorobenzene	ND		ug/kg	110	21.	1
Bis(2-chloroethyl)ether	ND		ug/kg	170	25.	1
2-Chloronaphthalene	ND		ug/kg	190	18.	1
1,2-Dichlorobenzene	ND		ug/kg	190	34.	1
1,3-Dichlorobenzene	ND		ug/kg	190	32.	1
1,4-Dichlorobenzene	ND		ug/kg	190	33.	1
3,3'-Dichlorobenzidine	ND		ug/kg	190	50.	1
2,4-Dinitrotoluene	ND		ug/kg	190	37.	1
2,6-Dinitrotoluene	ND		ug/kg	190	32.	1
Fluoranthene	1200		ug/kg	110	21.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	190	20.	1
4-Bromophenyl phenyl ether	ND		ug/kg	190	28.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	220	32.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	200	19.	1
Hexachlorobutadiene	ND		ug/kg	190	27.	1
Hexachlorocyclopentadiene	ND		ug/kg	530	170	1
Hexachloroethane	ND		ug/kg	150	30.	1
Isophorone	ND		ug/kg	170	24.	1
Naphthalene	49	J	ug/kg	190	23.	1
Nitrobenzene	ND		ug/kg	170	28.	1
NDPA/DPA	ND		ug/kg	150	21.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	190	29.	1
Bis(2-ethylhexyl)phthalate	ND		ug/kg	190	65.	1
Butyl benzyl phthalate	ND		ug/kg	190	47.	1
Di-n-butylphthalate	ND		ug/kg	190	35.	1
Di-n-octylphthalate	ND		ug/kg	190	64.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-03 Date Collected: 10/16/25 10:30

Client ID: P6SB09_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	190	17.	1
Dimethyl phthalate	ND		ug/kg	190	39.	1
Benzo(a)anthracene	550		ug/kg	110	21.	1
Benzo(a)pyrene	430		ug/kg	150	46.	1
Benzo(b)fluoranthene	630		ug/kg	110	31.	1
Benzo(k)fluoranthene	170		ug/kg	110	30.	1
Chrysene	570		ug/kg	110	19.	1
Acenaphthylene	42	J	ug/kg	150	29.	1
Anthracene	240		ug/kg	110	36.	1
Benzo(ghi)perylene	260		ug/kg	150	22.	1
Fluorene	84	J	ug/kg	190	18.	1
Phenanthrene	1000		ug/kg	110	23.	1
Dibenzo(a,h)anthracene	70	J	ug/kg	110	22.	1
Indeno(1,2,3-cd)pyrene	270		ug/kg	150	26.	1
Pyrene	940		ug/kg	110	18.	1
Biphenyl	ND		ug/kg	430	24.	1
4-Chloroaniline	ND		ug/kg	190	34.	1
2-Nitroaniline	ND		ug/kg	190	36.	1
3-Nitroaniline	ND		ug/kg	190	35.	1
4-Nitroaniline	ND		ug/kg	190	77.	1
Dibenzofuran	61	J	ug/kg	190	18.	1
2-Methylnaphthalene	26	J	ug/kg	220	22.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	190	20.	1
Acetophenone	ND		ug/kg	190	23.	1
2,4,6-Trichlorophenol	ND		ug/kg	110	35.	1
p-Chloro-m-cresol	ND		ug/kg	190	28.	1
2-Chlorophenol	ND		ug/kg	190	22.	1
2,4-Dichlorophenol	ND		ug/kg	170	30.	1
2,4-Dimethylphenol	ND		ug/kg	190	62.	1
2-Nitrophenol	ND		ug/kg	400	70.	1
4-Nitrophenol	ND		ug/kg	260	76.	1
2,4-Dinitrophenol	ND		ug/kg	900	87.	1
4,6-Dinitro-o-cresol	ND		ug/kg	490	90.	1
Pentachlorophenol	ND		ug/kg	150	41.	1
Phenol	ND		ug/kg	190	28.	1
2-Methylphenol	ND		ug/kg	190	29.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	270	29.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-03 Date Collected: 10/16/25 10:30

Client ID: P6SB09_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	190	36.	1
Benzoic Acid	190	J	ug/kg	600	190	1
Benzyl Alcohol	ND		ug/kg	190	57.	1
Carbazole	130	J	ug/kg	190	18.	1
1,4-Dioxane	ND		ug/kg	28	8.6	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	53		25-120
Phenol-d6	55		10-120
Nitrobenzene-d5	54		23-120
2-Fluorobiphenyl	54		30-120
2,4,6-Tribromophenol	56		10-136
4-Terphenyl-d14	52		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-04
Client ID: P6SB09_3-4
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 10:45
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/18/25 14:39
Analyst: CMM
Percent Solids: 85%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	ND		ug/kg	160	20.	1
1,2,4-Trichlorobenzene	ND		ug/kg	190	22.	1
Hexachlorobenzene	ND		ug/kg	120	22.	1
Bis(2-chloroethyl)ether	ND		ug/kg	180	26.	1
2-Chloronaphthalene	ND		ug/kg	190	19.	1
1,2-Dichlorobenzene	ND		ug/kg	190	35.	1
1,3-Dichlorobenzene	ND		ug/kg	190	33.	1
1,4-Dichlorobenzene	ND		ug/kg	190	34.	1
3,3'-Dichlorobenzidine	ND		ug/kg	190	52.	1
2,4-Dinitrotoluene	ND		ug/kg	190	39.	1
2,6-Dinitrotoluene	ND		ug/kg	190	33.	1
Fluoranthene	ND		ug/kg	120	22.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	190	21.	1
4-Bromophenyl phenyl ether	ND		ug/kg	190	30.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	230	33.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	210	20.	1
Hexachlorobutadiene	ND		ug/kg	190	28.	1
Hexachlorocyclopentadiene	ND		ug/kg	560	180	1
Hexachloroethane	ND		ug/kg	160	32.	1
Isophorone	ND		ug/kg	180	25.	1
Naphthalene	ND		ug/kg	190	24.	1
Nitrobenzene	ND		ug/kg	180	29.	1
NDPA/DPA	ND		ug/kg	160	22.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	190	30.	1
Bis(2-ethylhexyl)phthalate	ND		ug/kg	190	67.	1
Butyl benzyl phthalate	ND		ug/kg	190	49.	1
Di-n-butylphthalate	ND		ug/kg	190	37.	1
Di-n-octylphthalate	ND		ug/kg	190	66.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-04 Date Collected: 10/16/25 10:45

Client ID: P6SB09_3-4 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	190	18.	1
Dimethyl phthalate	ND		ug/kg	190	41.	1
Benzo(a)anthracene	ND		ug/kg	120	22.	1
Benzo(a)pyrene	ND		ug/kg	160	48.	1
Benzo(b)fluoranthene	ND		ug/kg	120	33.	1
Benzo(k)fluoranthene	ND		ug/kg	120	31.	1
Chrysene	ND		ug/kg	120	20.	1
Acenaphthylene	ND		ug/kg	160	30.	1
Anthracene	ND		ug/kg	120	38.	1
Benzo(ghi)perylene	ND		ug/kg	160	23.	1
Fluorene	ND		ug/kg	190	19.	1
Phenanthrene	ND		ug/kg	120	24.	1
Dibenzo(a,h)anthracene	ND		ug/kg	120	22.	1
Indeno(1,2,3-cd)pyrene	ND		ug/kg	160	27.	1
Pyrene	ND		ug/kg	120	19.	1
Biphenyl	ND		ug/kg	440	25.	1
4-Chloroaniline	ND		ug/kg	190	35.	1
2-Nitroaniline	ND		ug/kg	190	38.	1
3-Nitroaniline	ND		ug/kg	190	37.	1
4-Nitroaniline	ND		ug/kg	190	81.	1
Dibenzofuran	ND		ug/kg	190	18.	1
2-Methylnaphthalene	ND		ug/kg	230	24.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	190	20.	1
Acetophenone	ND		ug/kg	190	24.	1
2,4,6-Trichlorophenol	ND		ug/kg	120	37.	1
p-Chloro-m-cresol	ND		ug/kg	190	29.	1
2-Chlorophenol	ND		ug/kg	190	23.	1
2,4-Dichlorophenol	ND		ug/kg	180	31.	1
2,4-Dimethylphenol	ND		ug/kg	190	64.	1
2-Nitrophenol	ND		ug/kg	420	73.	1
4-Nitrophenol	ND		ug/kg	270	79.	1
2,4-Dinitrophenol	ND		ug/kg	930	91.	1
4,6-Dinitro-o-cresol	ND		ug/kg	510	93.	1
Pentachlorophenol	ND		ug/kg	160	43.	1
Phenol	ND		ug/kg	190	29.	1
2-Methylphenol	ND		ug/kg	190	30.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	280	30.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-04 Date Collected: 10/16/25 10:45

Client ID: P6SB09_3-4 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	190	37.	1
Benzoic Acid	ND		ug/kg	630	200	1
Benzyl Alcohol	ND		ug/kg	190	60.	1
Carbazole	ND		ug/kg	190	19.	1
1,4-Dioxane	ND		ug/kg	29	9.0	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	68		25-120
Phenol-d6	67		10-120
Nitrobenzene-d5	71		23-120
2-Fluorobiphenyl	51		30-120
2,4,6-Tribromophenol	61		10-136
4-Terphenyl-d14	66		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-05
Client ID: P6SB08_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 09:20
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/18/25 15:03
Analyst: CMM
Percent Solids: 84%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	680		ug/kg	160	20.	1
1,2,4-Trichlorobenzene	ND		ug/kg	190	22.	1
Hexachlorobenzene	ND		ug/kg	120	22.	1
Bis(2-chloroethyl)ether	ND		ug/kg	170	26.	1
2-Chloronaphthalene	ND		ug/kg	190	19.	1
1,2-Dichlorobenzene	ND		ug/kg	190	35.	1
1,3-Dichlorobenzene	ND		ug/kg	190	33.	1
1,4-Dichlorobenzene	ND		ug/kg	190	34.	1
3,3'-Dichlorobenzidine	ND		ug/kg	190	52.	1
2,4-Dinitrotoluene	ND		ug/kg	190	39.	1
2,6-Dinitrotoluene	ND		ug/kg	190	33.	1
Fluoranthene	5900		ug/kg	120	22.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	190	21.	1
4-Bromophenyl phenyl ether	ND		ug/kg	190	30.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	230	33.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	210	19.	1
Hexachlorobutadiene	ND		ug/kg	190	28.	1
Hexachlorocyclopentadiene	ND		ug/kg	560	180	1
Hexachloroethane	ND		ug/kg	160	31.	1
Isophorone	ND		ug/kg	170	25.	1
Naphthalene	1000		ug/kg	190	24.	1
Nitrobenzene	ND		ug/kg	170	29.	1
NDPA/DPA	ND		ug/kg	160	22.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	190	30.	1
Bis(2-ethylhexyl)phthalate	280		ug/kg	190	67.	1
Butyl benzyl phthalate	ND		ug/kg	190	49.	1
Di-n-butylphthalate	ND		ug/kg	190	37.	1
Di-n-octylphthalate	ND		ug/kg	190	66.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-05 Date Collected: 10/16/25 09:20

Client ID: P6SB08_0-1 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	190	18.	1
Dimethyl phthalate	ND		ug/kg	190	41.	1
Benzo(a)anthracene	3300		ug/kg	120	22.	1
Benzo(a)pyrene	2400		ug/kg	160	47.	1
Benzo(b)fluoranthene	3400		ug/kg	120	33.	1
Benzo(k)fluoranthene	1100		ug/kg	120	31.	1
Chrysene	2900		ug/kg	120	20.	1
Acenaphthylene	230		ug/kg	160	30.	1
Anthracene	2000		ug/kg	120	38.	1
Benzo(ghi)perylene	1300		ug/kg	160	23.	1
Fluorene	1000		ug/kg	190	19.	1
Phenanthrene	6700		ug/kg	120	24.	1
Dibenzo(a,h)anthracene	390		ug/kg	120	22.	1
Indeno(1,2,3-cd)pyrene	1400		ug/kg	160	27.	1
Pyrene	4600		ug/kg	120	19.	1
Biphenyl	100	J	ug/kg	440	25.	1
4-Chloroaniline	ND		ug/kg	190	35.	1
2-Nitroaniline	ND		ug/kg	190	37.	1
3-Nitroaniline	ND		ug/kg	190	37.	1
4-Nitroaniline	ND		ug/kg	190	80.	1
Dibenzofuran	760		ug/kg	190	18.	1
2-Methylnaphthalene	470		ug/kg	230	23.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	190	20.	1
Acetophenone	ND		ug/kg	190	24.	1
2,4,6-Trichlorophenol	ND		ug/kg	120	37.	1
p-Chloro-m-cresol	ND		ug/kg	190	29.	1
2-Chlorophenol	ND		ug/kg	190	23.	1
2,4-Dichlorophenol	ND		ug/kg	170	31.	1
2,4-Dimethylphenol	ND		ug/kg	190	64.	1
2-Nitrophenol	ND		ug/kg	420	73.	1
4-Nitrophenol	ND		ug/kg	270	79.	1
2,4-Dinitrophenol	ND		ug/kg	930	90.	1
4,6-Dinitro-o-cresol	ND		ug/kg	500	93.	1
Pentachlorophenol	ND		ug/kg	160	43.	1
Phenol	35	J	ug/kg	190	29.	1
2-Methylphenol	ND		ug/kg	190	30.	1
3-Methylphenol/4-Methylphenol	71	J	ug/kg	280	30.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-05 Date Collected: 10/16/25 09:20

Client ID: P6SB08_0-1 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	190	37.	1
Benzoic Acid	ND		ug/kg	630	200	1
Benzyl Alcohol	ND		ug/kg	190	59.	1
Carbazole	1100		ug/kg	190	19.	1
1,4-Dioxane	ND		ug/kg	29	8.9	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	64		25-120
Phenol-d6	65		10-120
Nitrobenzene-d5	70		23-120
2-Fluorobiphenyl	59		30-120
2,4,6-Tribromophenol	56		10-136
4-Terphenyl-d14	54		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-06
Client ID: P6SB08_2-3
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 09:40
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/18/25 15:27
Analyst: CMM
Percent Solids: 73%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	ND		ug/kg	180	23.	1
1,2,4-Trichlorobenzene	ND		ug/kg	220	26.	1
Hexachlorobenzene	ND		ug/kg	140	25.	1
Bis(2-chloroethyl)ether	ND		ug/kg	200	30.	1
2-Chloronaphthalene	ND		ug/kg	220	22.	1
1,2-Dichlorobenzene	ND		ug/kg	220	40.	1
1,3-Dichlorobenzene	ND		ug/kg	220	39.	1
1,4-Dichlorobenzene	ND		ug/kg	220	39.	1
3,3'-Dichlorobenzidine	ND		ug/kg	220	60.	1
2,4-Dinitrotoluene	ND		ug/kg	220	45.	1
2,6-Dinitrotoluene	ND		ug/kg	220	39.	1
Fluoranthene	32	J	ug/kg	140	26.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	220	24.	1
4-Bromophenyl phenyl ether	ND		ug/kg	220	34.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	270	38.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	240	22.	1
Hexachlorobutadiene	ND		ug/kg	220	33.	1
Hexachlorocyclopentadiene	ND		ug/kg	640	200	1
Hexachloroethane	ND		ug/kg	180	36.	1
Isophorone	ND		ug/kg	200	29.	1
Naphthalene	ND		ug/kg	220	27.	1
Nitrobenzene	ND		ug/kg	200	33.	1
NDPA/DPA	ND		ug/kg	180	26.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	220	35.	1
Bis(2-ethylhexyl)phthalate	ND		ug/kg	220	78.	1
Butyl benzyl phthalate	ND		ug/kg	220	57.	1
Di-n-butylphthalate	ND		ug/kg	220	43.	1
Di-n-octylphthalate	ND		ug/kg	220	77.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-06 Date Collected: 10/16/25 09:40

Client ID: P6SB08_2-3 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	220	21.	1
Dimethyl phthalate	ND		ug/kg	220	47.	1
Benzo(a)anthracene	28	J	ug/kg	140	25.	1
Benzo(a)pyrene	ND		ug/kg	180	55.	1
Benzo(b)fluoranthene	ND		ug/kg	140	38.	1
Benzo(k)fluoranthene	ND		ug/kg	140	36.	1
Chrysene	ND		ug/kg	140	23.	1
Acenaphthylene	ND		ug/kg	180	35.	1
Anthracene	ND		ug/kg	140	44.	1
Benzo(ghi)perylene	ND		ug/kg	180	26.	1
Fluorene	ND		ug/kg	220	22.	1
Phenanthrene	ND		ug/kg	140	27.	1
Dibenzo(a,h)anthracene	ND		ug/kg	140	26.	1
Indeno(1,2,3-cd)pyrene	ND		ug/kg	180	31.	1
Pyrene	28	J	ug/kg	140	22.	1
Biphenyl	ND		ug/kg	510	29.	1
4-Chloroaniline	ND		ug/kg	220	41.	1
2-Nitroaniline	ND		ug/kg	220	43.	1
3-Nitroaniline	ND		ug/kg	220	42.	1
4-Nitroaniline	ND		ug/kg	220	93.	1
Dibenzofuran	ND		ug/kg	220	21.	1
2-Methylnaphthalene	ND		ug/kg	270	27.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	220	24.	1
Acetophenone	ND		ug/kg	220	28.	1
2,4,6-Trichlorophenol	ND		ug/kg	140	43.	1
p-Chloro-m-cresol	ND		ug/kg	220	34.	1
2-Chlorophenol	ND		ug/kg	220	27.	1
2,4-Dichlorophenol	ND		ug/kg	200	36.	1
2,4-Dimethylphenol	ND		ug/kg	220	74.	1
2-Nitrophenol	ND		ug/kg	490	85.	1
4-Nitrophenol	ND		ug/kg	320	92.	1
2,4-Dinitrophenol	ND		ug/kg	1100	100	1
4,6-Dinitro-o-cresol	ND		ug/kg	590	110	1
Pentachlorophenol	ND		ug/kg	180	50.	1
Phenol	ND		ug/kg	220	34.	1
2-Methylphenol	ND		ug/kg	220	35.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	320	35.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-06 Date Collected: 10/16/25 09:40

Client ID: P6SB08_2-3 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	220	43.	1
Benzoic Acid	ND		ug/kg	730	230	1
Benzyl Alcohol	ND		ug/kg	220	69.	1
Carbazole	ND		ug/kg	220	22.	1
1,4-Dioxane	ND		ug/kg	34	10.	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	84		25-120
Phenol-d6	76		10-120
Nitrobenzene-d5	77		23-120
2-Fluorobiphenyl	61		30-120
2,4,6-Tribromophenol	59		10-136
4-Terphenyl-d14	61		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-07 D2
Client ID: P6SB01_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 13:00
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/23/25 17:00
Analyst: MRG
Percent Solids: 95%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Fluoranthene	120000		ug/kg	10000	2000	100
Phenanthrene	120000		ug/kg	10000	2100	100
Pyrene	94000		ug/kg	10000	1700	100

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-07 D
Client ID: P6SB01_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 13:00
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/23/25 16:34
Analyst: JG
Percent Solids: 95%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	17000		ug/kg	1400	180	10
1,2,4-Trichlorobenzene	ND		ug/kg	1700	200	10
Hexachlorobenzene	ND		ug/kg	1000	190	10
Bis(2-chloroethyl)ether	ND		ug/kg	1500	230	10
2-Chloronaphthalene	ND		ug/kg	1700	170	10
1,2-Dichlorobenzene	ND		ug/kg	1700	310	10
1,3-Dichlorobenzene	ND		ug/kg	1700	300	10
1,4-Dichlorobenzene	ND		ug/kg	1700	300	10
3,3'-Dichlorobenzidine	ND		ug/kg	1700	460	10
2,4-Dinitrotoluene	ND		ug/kg	1700	340	10
2,6-Dinitrotoluene	ND		ug/kg	1700	290	10
Fluoranthene	99000	E	ug/kg	1000	200	10
4-Chlorophenyl phenyl ether	ND		ug/kg	1700	180	10
4-Bromophenyl phenyl ether	ND		ug/kg	1700	260	10
Bis(2-chloroisopropyl)ether	ND		ug/kg	2100	290	10
Bis(2-chloroethoxy)methane	ND		ug/kg	1800	170	10
Hexachlorobutadiene	ND		ug/kg	1700	250	10
Hexachlorocyclopentadiene	ND		ug/kg	4900	1600	10
Hexachloroethane	ND		ug/kg	1400	280	10
Isophorone	ND		ug/kg	1500	220	10
Naphthalene	12000		ug/kg	1700	210	10
Nitrobenzene	ND		ug/kg	1500	250	10
NDPA/DPA	ND		ug/kg	1400	200	10
n-Nitrosodi-n-propylamine	ND		ug/kg	1700	260	10
Bis(2-ethylhexyl)phthalate	ND		ug/kg	1700	590	10
Butyl benzyl phthalate	ND		ug/kg	1700	430	10
Di-n-butylphthalate	ND		ug/kg	1700	320	10
Di-n-octylphthalate	ND		ug/kg	1700	580	10

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-07 D Date Collected: 10/16/25 13:00

Client ID: P6SB01_0-1 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	1700	160	10
Dimethyl phthalate	ND		ug/kg	1700	360	10
Benzo(a)anthracene	56000		ug/kg	1000	190	10
Benzo(a)pyrene	49000		ug/kg	1400	420	10
Benzo(b)fluoranthene	65000		ug/kg	1000	290	10
Benzo(k)fluoranthene	16000		ug/kg	1000	270	10
Chrysene	48000		ug/kg	1000	180	10
Acenaphthylene	310	J	ug/kg	1400	260	10
Anthracene	38000		ug/kg	1000	330	10
Benzo(ghi)perylene	31000		ug/kg	1400	200	10
Fluorene	18000		ug/kg	1700	170	10
Phenanthrene	100000	E	ug/kg	1000	210	10
Dibenzo(a,h)anthracene	6200		ug/kg	1000	200	10
Indeno(1,2,3-cd)pyrene	32000		ug/kg	1400	240	10
Pyrene	81000	E	ug/kg	1000	170	10
Biphenyl	1400	J	ug/kg	3900	220	10
4-Chloroaniline	ND		ug/kg	1700	310	10
2-Nitroaniline	ND		ug/kg	1700	330	10
3-Nitroaniline	ND		ug/kg	1700	320	10
4-Nitroaniline	ND		ug/kg	1700	710	10
Dibenzofuran	12000		ug/kg	1700	160	10
2-Methylnaphthalene	3300		ug/kg	2100	210	10
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	1700	180	10
Acetophenone	ND		ug/kg	1700	210	10
2,4,6-Trichlorophenol	ND		ug/kg	1000	320	10
p-Chloro-m-cresol	ND		ug/kg	1700	260	10
2-Chlorophenol	ND		ug/kg	1700	200	10
2,4-Dichlorophenol	ND		ug/kg	1500	280	10
2,4-Dimethylphenol	ND		ug/kg	1700	570	10
2-Nitrophenol	ND		ug/kg	3700	640	10
4-Nitrophenol	ND		ug/kg	2400	700	10
2,4-Dinitrophenol	ND		ug/kg	8200	800	10
4,6-Dinitro-o-cresol	ND		ug/kg	4500	820	10
Pentachlorophenol	ND		ug/kg	1400	380	10
Phenol	ND		ug/kg	1700	260	10
2-Methylphenol	ND		ug/kg	1700	270	10
3-Methylphenol/4-Methylphenol	ND		ug/kg	2500	270	10

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-07 D Date Collected: 10/16/25 13:00

Client ID: P6SB01_0-1 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	1700	330	10
Benzoic Acid	ND		ug/kg	5600	1700	10
Benzyl Alcohol	ND		ug/kg	1700	520	10
Carbazole	18000		ug/kg	1700	170	10
1,4-Dioxane	ND		ug/kg	260	79.	10

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	51		25-120
Phenol-d6	49		10-120
Nitrobenzene-d5	50		23-120
2-Fluorobiphenyl	60		30-120
2,4,6-Tribromophenol	57		10-136
4-Terphenyl-d14	57		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-08
Client ID: P6SB01_5-6
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 13:45
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/18/25 16:14
Analyst: CMM
Percent Solids: 84%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	ND		ug/kg	150	20.	1
1,2,4-Trichlorobenzene	ND		ug/kg	190	22.	1
Hexachlorobenzene	ND		ug/kg	120	22.	1
Bis(2-chloroethyl)ether	ND		ug/kg	170	26.	1
2-Chloronaphthalene	ND		ug/kg	190	19.	1
1,2-Dichlorobenzene	ND		ug/kg	190	34.	1
1,3-Dichlorobenzene	ND		ug/kg	190	33.	1
1,4-Dichlorobenzene	ND		ug/kg	190	34.	1
3,3'-Dichlorobenzidine	ND		ug/kg	190	51.	1
2,4-Dinitrotoluene	ND		ug/kg	190	38.	1
2,6-Dinitrotoluene	ND		ug/kg	190	33.	1
Fluoranthene	120		ug/kg	120	22.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	190	20.	1
4-Bromophenyl phenyl ether	ND		ug/kg	190	29.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	230	33.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	210	19.	1
Hexachlorobutadiene	ND		ug/kg	190	28.	1
Hexachlorocyclopentadiene	ND		ug/kg	550	170	1
Hexachloroethane	ND		ug/kg	150	31.	1
Isophorone	ND		ug/kg	170	25.	1
Naphthalene	26	J	ug/kg	190	23.	1
Nitrobenzene	ND		ug/kg	170	28.	1
NDPA/DPA	ND		ug/kg	150	22.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	190	30.	1
Bis(2-ethylhexyl)phthalate	ND		ug/kg	190	66.	1
Butyl benzyl phthalate	ND		ug/kg	190	48.	1
Di-n-butylphthalate	ND		ug/kg	190	36.	1
Di-n-octylphthalate	ND		ug/kg	190	65.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-08 Date Collected: 10/16/25 13:45

Client ID: P6SB01_5-6 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	190	18.	1
Dimethyl phthalate	ND		ug/kg	190	40.	1
Benzo(a)anthracene	92	J	ug/kg	120	22.	1
Benzo(a)pyrene	ND		ug/kg	150	47.	1
Benzo(b)fluoranthene	45	J	ug/kg	120	32.	1
Benzo(k)fluoranthene	ND		ug/kg	120	31.	1
Chrysene	70	J	ug/kg	120	20.	1
Acenaphthylene	41	J	ug/kg	150	30.	1
Anthracene	ND		ug/kg	120	37.	1
Benzo(ghi)perylene	ND		ug/kg	150	23.	1
Fluorene	33	J	ug/kg	190	19.	1
Phenanthrene	77	J	ug/kg	120	23.	1
Dibenzo(a,h)anthracene	ND		ug/kg	120	22.	1
Indeno(1,2,3-cd)pyrene	ND		ug/kg	150	27.	1
Pyrene	120		ug/kg	120	19.	1
Biphenyl	ND		ug/kg	440	25.	1
4-Chloroaniline	ND		ug/kg	190	35.	1
2-Nitroaniline	ND		ug/kg	190	37.	1
3-Nitroaniline	ND		ug/kg	190	36.	1
4-Nitroaniline	ND		ug/kg	190	80.	1
Dibenzofuran	ND		ug/kg	190	18.	1
2-Methylnaphthalene	ND		ug/kg	230	23.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	190	20.	1
Acetophenone	ND		ug/kg	190	24.	1
2,4,6-Trichlorophenol	ND		ug/kg	120	36.	1
p-Chloro-m-cresol	ND		ug/kg	190	29.	1
2-Chlorophenol	ND		ug/kg	190	23.	1
2,4-Dichlorophenol	ND		ug/kg	170	31.	1
2,4-Dimethylphenol	ND		ug/kg	190	63.	1
2-Nitrophenol	ND		ug/kg	420	72.	1
4-Nitrophenol	ND		ug/kg	270	78.	1
2,4-Dinitrophenol	ND		ug/kg	920	90.	1
4,6-Dinitro-o-cresol	ND		ug/kg	500	92.	1
Pentachlorophenol	ND		ug/kg	150	42.	1
Phenol	ND		ug/kg	190	29.	1
2-Methylphenol	ND		ug/kg	190	30.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	280	30.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-08 Date Collected: 10/16/25 13:45

Client ID: P6SB01_5-6 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	190	37.	1
Benzoic Acid	ND		ug/kg	620	190	1
Benzyl Alcohol	ND		ug/kg	190	59.	1
Carbazole	24	J	ug/kg	190	19.	1
1,4-Dioxane	ND		ug/kg	29	8.8	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	77		25-120
Phenol-d6	77		10-120
Nitrobenzene-d5	76		23-120
2-Fluorobiphenyl	63		30-120
2,4,6-Tribromophenol	68		10-136
4-Terphenyl-d14	64		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-09
Client ID: P6SB05_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 14:05
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/20/25 01:01
Analyst: CMM
Percent Solids: 92%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	590		ug/kg	140	18.	1
1,2,4-Trichlorobenzene	ND		ug/kg	180	20.	1
Hexachlorobenzene	ND		ug/kg	100	20.	1
Bis(2-chloroethyl)ether	ND		ug/kg	160	24.	1
2-Chloronaphthalene	ND		ug/kg	180	17.	1
1,2-Dichlorobenzene	ND		ug/kg	180	32.	1
1,3-Dichlorobenzene	ND		ug/kg	180	30.	1
1,4-Dichlorobenzene	ND		ug/kg	180	31.	1
3,3'-Dichlorobenzidine	ND		ug/kg	180	47.	1
2,4-Dinitrotoluene	ND		ug/kg	180	35.	1
2,6-Dinitrotoluene	ND		ug/kg	180	30.	1
Fluoranthene	4200		ug/kg	100	20.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	180	19.	1
4-Bromophenyl phenyl ether	ND		ug/kg	180	27.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	210	30.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	190	18.	1
Hexachlorobutadiene	ND		ug/kg	180	26.	1
Hexachlorocyclopentadiene	ND		ug/kg	500	160	1
Hexachloroethane	ND		ug/kg	140	28.	1
Isophorone	ND		ug/kg	160	23.	1
Naphthalene	250		ug/kg	180	21.	1
Nitrobenzene	ND		ug/kg	160	26.	1
NDPA/DPA	ND		ug/kg	140	20.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	180	27.	1
Bis(2-ethylhexyl)phthalate	ND		ug/kg	180	61.	1
Butyl benzyl phthalate	ND		ug/kg	180	44.	1
Di-n-butylphthalate	ND		ug/kg	180	33.	1
Di-n-octylphthalate	ND		ug/kg	180	60.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-09 Date Collected: 10/16/25 14:05

Client ID: P6SB05_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	180	16.	1
Dimethyl phthalate	ND		ug/kg	180	37.	1
Benzo(a)anthracene	2000		ug/kg	100	20.	1
Benzo(a)pyrene	2300		ug/kg	140	43.	1
Benzo(b)fluoranthene	2600		ug/kg	100	30.	1
Benzo(k)fluoranthene	940		ug/kg	100	28.	1
Chrysene	1800		ug/kg	100	18.	1
Acenaphthylene	170		ug/kg	140	27.	1
Anthracene	1000		ug/kg	100	34.	1
Benzo(ghi)perylene	2000		ug/kg	140	21.	1
Fluorene	460		ug/kg	180	17.	1
Phenanthrene	3700		ug/kg	100	21.	1
Dibenzo(a,h)anthracene	650		ug/kg	100	20.	1
Indeno(1,2,3-cd)pyrene	1600		ug/kg	140	24.	1
Pyrene	3700		ug/kg	100	17.	1
Biphenyl	53	J	ug/kg	400	23.	1
4-Chloroaniline	ND		ug/kg	180	32.	1
2-Nitroaniline	ND		ug/kg	180	34.	1
3-Nitroaniline	ND		ug/kg	180	33.	1
4-Nitroaniline	ND		ug/kg	180	73.	1
Dibenzofuran	280		ug/kg	180	17.	1
2-Methylnaphthalene	170	J	ug/kg	210	21.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	180	18.	1
Acetophenone	38	J	ug/kg	180	22.	1
2,4,6-Trichlorophenol	ND		ug/kg	100	33.	1
p-Chloro-m-cresol	ND		ug/kg	180	26.	1
2-Chlorophenol	ND		ug/kg	180	21.	1
2,4-Dichlorophenol	ND		ug/kg	160	28.	1
2,4-Dimethylphenol	ND		ug/kg	180	58.	1
2-Nitrophenol	ND		ug/kg	380	66.	1
4-Nitrophenol	ND		ug/kg	250	72.	1
2,4-Dinitrophenol	ND		ug/kg	840	82.	1
4,6-Dinitro-o-cresol	ND		ug/kg	460	84.	1
Pentachlorophenol	ND		ug/kg	140	39.	1
Phenol	ND		ug/kg	180	26.	1
2-Methylphenol	ND		ug/kg	180	27.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	250	28.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-09 Date Collected: 10/16/25 14:05

Client ID: P6SB05_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	180	34.	1
Benzoic Acid	ND		ug/kg	570	180	1
Benzyl Alcohol	ND		ug/kg	180	54.	1
Carbazole	320		ug/kg	180	17.	1
1,4-Dioxane	ND		ug/kg	26	8.1	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	54		25-120
Phenol-d6	55		10-120
Nitrobenzene-d5	62		23-120
2-Fluorobiphenyl	68		30-120
2,4,6-Tribromophenol	75		10-136
4-Terphenyl-d14	65		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-10
Client ID: P6SB05_5-6
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 14:30
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8270E
Analytical Date: 10/20/25 01:19
Analyst: CMM
Percent Solids: 84%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Acenaphthene	ND		ug/kg	150	20.	1
1,2,4-Trichlorobenzene	ND		ug/kg	190	22.	1
Hexachlorobenzene	ND		ug/kg	120	22.	1
Bis(2-chloroethyl)ether	ND		ug/kg	170	26.	1
2-Chloronaphthalene	ND		ug/kg	190	19.	1
1,2-Dichlorobenzene	ND		ug/kg	190	35.	1
1,3-Dichlorobenzene	ND		ug/kg	190	33.	1
1,4-Dichlorobenzene	ND		ug/kg	190	34.	1
3,3'-Dichlorobenzidine	ND		ug/kg	190	52.	1
2,4-Dinitrotoluene	ND		ug/kg	190	39.	1
2,6-Dinitrotoluene	ND		ug/kg	190	33.	1
Fluoranthene	65	J	ug/kg	120	22.	1
4-Chlorophenyl phenyl ether	ND		ug/kg	190	21.	1
4-Bromophenyl phenyl ether	ND		ug/kg	190	30.	1
Bis(2-chloroisopropyl)ether	ND		ug/kg	230	33.	1
Bis(2-chloroethoxy)methane	ND		ug/kg	210	19.	1
Hexachlorobutadiene	ND		ug/kg	190	28.	1
Hexachlorocyclopentadiene	ND		ug/kg	550	180	1
Hexachloroethane	ND		ug/kg	150	31.	1
Isophorone	ND		ug/kg	170	25.	1
Naphthalene	ND		ug/kg	190	24.	1
Nitrobenzene	ND		ug/kg	170	29.	1
NDPA/DPA	ND		ug/kg	150	22.	1
n-Nitrosodi-n-propylamine	ND		ug/kg	190	30.	1
Bis(2-ethylhexyl)phthalate	ND		ug/kg	190	67.	1
Butyl benzyl phthalate	ND		ug/kg	190	49.	1
Di-n-butylphthalate	ND		ug/kg	190	37.	1
Di-n-octylphthalate	ND		ug/kg	190	66.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-10 Date Collected: 10/16/25 14:30

Client ID: P6SB05_5-6 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Diethyl phthalate	ND		ug/kg	190	18.	1
Dimethyl phthalate	ND		ug/kg	190	41.	1
Benzo(a)anthracene	47	J	ug/kg	120	22.	1
Benzo(a)pyrene	56	J	ug/kg	150	47.	1
Benzo(b)fluoranthene	47	J	ug/kg	120	33.	1
Benzo(k)fluoranthene	ND		ug/kg	120	31.	1
Chrysene	35	J	ug/kg	120	20.	1
Acenaphthylene	51	J	ug/kg	150	30.	1
Anthracene	ND		ug/kg	120	38.	1
Benzo(ghi)perylene	350		ug/kg	150	23.	1
Fluorene	ND		ug/kg	190	19.	1
Phenanthrene	62	J	ug/kg	120	24.	1
Dibenzo(a,h)anthracene	42	J	ug/kg	120	22.	1
Indeno(1,2,3-cd)pyrene	190		ug/kg	150	27.	1
Pyrene	54	J	ug/kg	120	19.	1
Biphenyl	ND		ug/kg	440	25.	1
4-Chloroaniline	ND		ug/kg	190	35.	1
2-Nitroaniline	ND		ug/kg	190	37.	1
3-Nitroaniline	ND		ug/kg	190	36.	1
4-Nitroaniline	ND		ug/kg	190	80.	1
Dibenzofuran	ND		ug/kg	190	18.	1
2-Methylnaphthalene	ND		ug/kg	230	23.	1
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	190	20.	1
Acetophenone	ND		ug/kg	190	24.	1
2,4,6-Trichlorophenol	ND		ug/kg	120	37.	1
p-Chloro-m-cresol	ND		ug/kg	190	29.	1
2-Chlorophenol	ND		ug/kg	190	23.	1
2,4-Dichlorophenol	ND		ug/kg	170	31.	1
2,4-Dimethylphenol	ND		ug/kg	190	64.	1
2-Nitrophenol	ND		ug/kg	420	73.	1
4-Nitrophenol	ND		ug/kg	270	79.	1
2,4-Dinitrophenol	ND		ug/kg	930	90.	1
4,6-Dinitro-o-cresol	ND		ug/kg	500	93.	1
Pentachlorophenol	ND		ug/kg	150	43.	1
Phenol	ND		ug/kg	190	29.	1
2-Methylphenol	ND		ug/kg	190	30.	1
3-Methylphenol/4-Methylphenol	ND		ug/kg	280	30.	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-10 Date Collected: 10/16/25 14:30

Client ID: P6SB05_5-6 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
2,4,5-Trichlorophenol	ND		ug/kg	190	37.	1
Benzoic Acid	ND		ug/kg	630	200	1
Benzyl Alcohol	ND		ug/kg	190	59.	1
Carbazole	ND		ug/kg	190	19.	1
1,4-Dioxane	ND		ug/kg	29	8.9	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	73		25-120
Phenol-d6	74		10-120
Nitrobenzene-d5	68		23-120
2-Fluorobiphenyl	75		30-120
2,4,6-Tribromophenol	89		10-136
4-Terphenyl-d14	71		18-120

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/18/25 11:54
Analyst: CMM

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01-10 Batch: WG2129454-1					
Acenaphthene	ND		ug/kg	130	17.
1,2,4-Trichlorobenzene	ND		ug/kg	160	19.
Hexachlorobenzene	ND		ug/kg	98	18.
Bis(2-chloroethyl)ether	ND		ug/kg	150	22.
2-Chloronaphthalene	ND		ug/kg	160	16.
1,2-Dichlorobenzene	ND		ug/kg	160	29.
1,3-Dichlorobenzene	ND		ug/kg	160	28.
1,4-Dichlorobenzene	ND		ug/kg	160	28.
3,3'-Dichlorobenzidine	ND		ug/kg	160	43.
2,4-Dinitrotoluene	ND		ug/kg	160	32.
2,6-Dinitrotoluene	ND		ug/kg	160	28.
Fluoranthene	ND		ug/kg	98	19.
4-Chlorophenyl phenyl ether	ND		ug/kg	160	17.
4-Bromophenyl phenyl ether	ND		ug/kg	160	25.
Bis(2-chloroisopropyl)ether	ND		ug/kg	200	28.
Bis(2-chloroethoxy)methane	ND		ug/kg	180	16.
Hexachlorobutadiene	ND		ug/kg	160	24.
Hexachlorocyclopentadiene	ND		ug/kg	460	150
Hexachloroethane	ND		ug/kg	130	26.
Isophorone	ND		ug/kg	150	21.
Naphthalene	ND		ug/kg	160	20.
Nitrobenzene	ND		ug/kg	150	24.
NDPA/DPA	ND		ug/kg	130	18.
n-Nitrosodi-n-propylamine	ND		ug/kg	160	25.

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/18/25 11:54
Analyst: CMM

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01-10 Batch: WG2129454-1					
Bis(2-ethylhexyl)phthalate	ND		ug/kg	160	56.
Butyl benzyl phthalate	ND		ug/kg	160	41.
Di-n-butylphthalate	ND		ug/kg	160	31.
Di-n-octylphthalate	ND		ug/kg	160	55.
Diethyl phthalate	ND		ug/kg	160	15.
Dimethyl phthalate	ND		ug/kg	160	34.
Benzo(a)anthracene	ND		ug/kg	98	18.
Benzo(a)pyrene	ND		ug/kg	130	40.
Benzo(b)fluoranthene	ND		ug/kg	98	27.
Benzo(k)fluoranthene	ND		ug/kg	98	26.
Chrysene	ND		ug/kg	98	17.
Acenaphthylene	ND		ug/kg	130	25.
Anthracene	ND		ug/kg	98	32.
Benzo(ghi)perylene	ND		ug/kg	130	19.
Fluorene	ND		ug/kg	160	16.
Phenanthrene	ND		ug/kg	98	20.
Dibenzo(a,h)anthracene	ND		ug/kg	98	19.
Indeno(1,2,3-cd)pyrene	ND		ug/kg	130	23.
Pyrene	ND		ug/kg	98	16.
Biphenyl	ND		ug/kg	370	21.
4-Chloroaniline	ND		ug/kg	160	30.
2-Nitroaniline	ND		ug/kg	160	31.
3-Nitroaniline	ND		ug/kg	160	31.
4-Nitroaniline	ND		ug/kg	160	67.

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/18/25 11:54
Analyst: CMM

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01-10 Batch: WG2129454-1					
Dibenzofuran	ND		ug/kg	160	15.
2-Methylnaphthalene	ND		ug/kg	200	20.
1,2,4,5-Tetrachlorobenzene	ND		ug/kg	160	17.
Acetophenone	ND		ug/kg	160	20.
2,4,6-Trichlorophenol	ND		ug/kg	98	31.
p-Chloro-m-cresol	ND		ug/kg	160	24.
2-Chlorophenol	ND		ug/kg	160	19.
2,4-Dichlorophenol	ND		ug/kg	150	26.
2,4-Dimethylphenol	ND		ug/kg	160	54.
2-Nitrophenol	ND		ug/kg	350	61.
4-Nitrophenol	ND		ug/kg	230	66.
2,4-Dinitrophenol	ND		ug/kg	780	76.
4,6-Dinitro-o-cresol	ND		ug/kg	420	78.
Pentachlorophenol	ND		ug/kg	130	36.
Phenol	ND		ug/kg	160	24.
2-Methylphenol	ND		ug/kg	160	25.
3-Methylphenol/4-Methylphenol	ND		ug/kg	230	25.
2,4,5-Trichlorophenol	ND		ug/kg	160	31.
Benzoic Acid	ND		ug/kg	530	160
Benzyl Alcohol	ND		ug/kg	160	50.
Carbazole	ND		ug/kg	160	16.
1,4-Dioxane	ND		ug/kg	24	7.5

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/18/25 11:54
Analyst: CMM

Extraction Method: EPA 3546
Extraction Date: 10/17/25 23:56

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01-10 Batch: WG2129454-1					

Surrogate	%Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	63		25-120
Phenol-d6	66		10-120
Nitrobenzene-d5	72		23-120
2-Fluorobiphenyl	56		30-120
2,4,6-Tribromophenol	46		10-136
4-Terphenyl-d14	57		18-120

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-10 Batch: WG2129454-2 WG2129454-3								
Acenaphthene	63		66		31-137	5		50
1,2,4-Trichlorobenzene	56		54		38-107	4		50
Hexachlorobenzene	59		65		40-140	10		50
Bis(2-chloroethyl)ether	68		68		40-140	0		50
2-Chloronaphthalene	61		70		40-140	14		50
1,2-Dichlorobenzene	60		60		40-140	0		50
1,3-Dichlorobenzene	59		62		40-140	5		50
1,4-Dichlorobenzene	59		60		28-104	2		50
3,3'-Dichlorobenzidine	42		44		40-140	5		50
2,4-Dinitrotoluene	80		76		40-132	5		50
2,6-Dinitrotoluene	74		78		40-140	5		50
Fluoranthene	57		64		40-140	12		50
4-Chlorophenyl phenyl ether	58		60		40-140	3		50
4-Bromophenyl phenyl ether	56		62		40-140	10		50
Bis(2-chloroisopropyl)ether	68		70		40-140	3		50
Bis(2-chloroethoxy)methane	75		61		40-117	21		50
Hexachlorobutadiene	53		59		40-140	11		50
Hexachlorocyclopentadiene	50		59		40-140	17		50
Hexachloroethane	63		68		40-140	8		50

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-10 Batch: WG2129454-2 WG2129454-3								
Isophorone	66		71		40-140	7		50
Naphthalene	62		67		40-140	8		50
Nitrobenzene	71		78		40-140	9		50
NDPA/DPA	62		61		36-157	2		50
n-Nitrosodi-n-propylamine	63		67		32-121	6		50
Bis(2-ethylhexyl)phthalate	77		79		40-140	3		50
Butyl benzyl phthalate	70		83		40-140	17		50
Di-n-butylphthalate	70		69		40-140	1		50
Di-n-octylphthalate	78		84		40-140	7		50
Diethyl phthalate	68		66		40-140	3		50
Dimethyl phthalate	61		68		40-140	11		50
Benzo(a)anthracene	57		61		40-140	7		50
Benzo(a)pyrene	62		68		40-140	9		50
Benzo(b)fluoranthene	59		65		40-140	10		50
Benzo(k)fluoranthene	60		65		40-140	8		50
Chrysene	58		65		40-140	11		50
Acenaphthylene	66		67		40-140	2		50
Anthracene	62		63		40-140	2		50
Benzo(ghi)perylene	60		62		40-140	3		50

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-10 Batch: WG2129454-2 WG2129454-3								
Fluorene	63		62		40-140	2		50
Phenanthrene	62		63		40-140	2		50
Dibenzo(a,h)anthracene	62		63		40-140	2		50
Indeno(1,2,3-cd)pyrene	60		62		40-140	3		50
Pyrene	56		66		35-142	16		50
Biphenyl	60		70		37-127	15		50
4-Chloroaniline	48		51		40-140	6		50
2-Nitroaniline	75		88		47-134	16		50
3-Nitroaniline	63		68		26-129	8		50
4-Nitroaniline	70		72		41-125	3		50
Dibenzofuran	68		68		40-140	0		50
2-Methylnaphthalene	65		69		40-140	6		50
1,2,4,5-Tetrachlorobenzene	58		68		40-117	16		50
Acetophenone	71		71		14-144	0		50
2,4,6-Trichlorophenol	56		65		30-130	15		50
p-Chloro-m-cresol	69		72		26-103	4		50
2-Chlorophenol	66		63		25-102	5		50
2,4-Dichlorophenol	63		54		30-130	15		50
2,4-Dimethylphenol	69		62		30-130	11		50

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-10 Batch: WG2129454-2 WG2129454-3								
2-Nitrophenol	74		73		30-130	1		50
4-Nitrophenol	84		82		11-114	2		50
2,4-Dinitrophenol	68		59		4-130	14		50
4,6-Dinitro-o-cresol	80		78		10-130	3		50
Pentachlorophenol	52		53		17-109	2		50
Phenol	64		63		26-90	2		50
2-Methylphenol	64		67		30-130	5		50
3-Methylphenol/4-Methylphenol	68		76		30-130	11		50
2,4,5-Trichlorophenol	54		66		30-130	20		50
Benzoic Acid	34		25		10-110	31		50
Benzyl Alcohol	71		72		40-140	1		50
Carbazole	61		65		54-128	6		50
1,4-Dioxane	58		67		40-140	14		50

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits

Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-10 Batch: WG2129454-2 WG2129454-3

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria
2-Fluorophenol	69		71		25-120
Phenol-d6	66		65		10-120
Nitrobenzene-d5	70		79		23-120
2-Fluorobiphenyl	52		65		30-120
2,4,6-Tribromophenol	58		51		10-136
4-Terphenyl-d14	58		63		18-120

PCBS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-01
Client ID: P6SB02_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 08:15
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/18/25 08:47
Analyst: AKM
Percent Solids: 77%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 22:46
Cleanup Method: EPA 3665A
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	64.1	5.69	1	A
Aroclor 1221	ND		ug/kg	64.1	6.42	1	A
Aroclor 1232	ND		ug/kg	64.1	13.6	1	A
Aroclor 1242	ND		ug/kg	64.1	8.64	1	A
Aroclor 1248	ND		ug/kg	64.1	9.61	1	A
Aroclor 1254	16.6	JIP	ug/kg	64.1	7.01	1	A
Aroclor 1260	22.0	J	ug/kg	64.1	11.8	1	A
Aroclor 1262	ND		ug/kg	64.1	8.14	1	A
Aroclor 1268	ND		ug/kg	64.1	6.64	1	A
PCBs, Total	38.6	J	ug/kg	64.1	5.69	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	77		30-150	A
Decachlorobiphenyl	65		30-150	A
2,4,5,6-Tetrachloro-m-xylene	73		30-150	B
Decachlorobiphenyl	98		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-02
Client ID: P6SB02_3-4
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 08:45
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/18/25 08:55
Analyst: AKM
Percent Solids: 82%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 22:46
Cleanup Method: EPA 3665A
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	59.7	5.30	1	A
Aroclor 1221	ND		ug/kg	59.7	5.98	1	A
Aroclor 1232	ND		ug/kg	59.7	12.6	1	A
Aroclor 1242	ND		ug/kg	59.7	8.05	1	A
Aroclor 1248	ND		ug/kg	59.7	8.95	1	A
Aroclor 1254	ND		ug/kg	59.7	6.53	1	A
Aroclor 1260	ND		ug/kg	59.7	11.0	1	A
Aroclor 1262	ND		ug/kg	59.7	7.58	1	A
Aroclor 1268	ND		ug/kg	59.7	6.18	1	A
PCBs, Total	ND		ug/kg	59.7	5.30	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	71		30-150	A
Decachlorobiphenyl	59		30-150	A
2,4,5,6-Tetrachloro-m-xylene	69		30-150	B
Decachlorobiphenyl	60		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-03
Client ID: P6SB09_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 10:30
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/18/25 09:03
Analyst: AKM
Percent Solids: 87%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 22:46
Cleanup Method: EPA 3665A
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	55.4	4.92	1	A
Aroclor 1221	ND		ug/kg	55.4	5.55	1	A
Aroclor 1232	ND		ug/kg	55.4	11.7	1	A
Aroclor 1242	ND		ug/kg	55.4	7.47	1	A
Aroclor 1248	ND		ug/kg	55.4	8.31	1	A
Aroclor 1254	ND		ug/kg	55.4	6.06	1	A
Aroclor 1260	ND		ug/kg	55.4	10.2	1	A
Aroclor 1262	ND		ug/kg	55.4	7.04	1	A
Aroclor 1268	ND		ug/kg	55.4	5.74	1	A
PCBs, Total	ND		ug/kg	55.4	4.92	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	74		30-150	A
Decachlorobiphenyl	66		30-150	A
2,4,5,6-Tetrachloro-m-xylene	76		30-150	B
Decachlorobiphenyl	71		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-04
Client ID: P6SB09_3-4
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 10:45
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/18/25 09:11
Analyst: AKM
Percent Solids: 85%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 22:46
Cleanup Method: EPA 3665A
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	57.5	5.10	1	A
Aroclor 1221	ND		ug/kg	57.5	5.76	1	A
Aroclor 1232	ND		ug/kg	57.5	12.2	1	A
Aroclor 1242	ND		ug/kg	57.5	7.75	1	A
Aroclor 1248	ND		ug/kg	57.5	8.62	1	A
Aroclor 1254	ND		ug/kg	57.5	6.29	1	A
Aroclor 1260	ND		ug/kg	57.5	10.6	1	A
Aroclor 1262	ND		ug/kg	57.5	7.30	1	A
Aroclor 1268	ND		ug/kg	57.5	5.95	1	A
PCBs, Total	ND		ug/kg	57.5	5.10	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	71		30-150	A
Decachlorobiphenyl	61		30-150	A
2,4,5,6-Tetrachloro-m-xylene	70		30-150	B
Decachlorobiphenyl	58		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-05
Client ID: P6SB08_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 09:20
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/18/25 09:20
Analyst: AKM
Percent Solids: 84%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 22:46
Cleanup Method: EPA 3665A
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	54.2	4.81	1	A
Aroclor 1221	ND		ug/kg	54.2	5.43	1	A
Aroclor 1232	ND		ug/kg	54.2	11.5	1	A
Aroclor 1242	ND		ug/kg	54.2	7.30	1	A
Aroclor 1248	ND		ug/kg	54.2	8.12	1	A
Aroclor 1254	11.1	J	ug/kg	54.2	5.92	1	A
Aroclor 1260	18.2	J	ug/kg	54.2	10.0	1	A
Aroclor 1262	ND		ug/kg	54.2	6.88	1	A
Aroclor 1268	ND		ug/kg	54.2	5.61	1	A
PCBs, Total	29.3	J	ug/kg	54.2	4.81	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	81		30-150	A
Decachlorobiphenyl	71		30-150	A
2,4,5,6-Tetrachloro-m-xylene	77		30-150	B
Decachlorobiphenyl	73		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-06
Client ID: P6SB08_2-3
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 09:40
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/18/25 09:28
Analyst: AKM
Percent Solids: 73%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 22:46
Cleanup Method: EPA 3665A
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	64.5	5.72	1	A
Aroclor 1221	ND		ug/kg	64.5	6.46	1	A
Aroclor 1232	ND		ug/kg	64.5	13.7	1	A
Aroclor 1242	ND		ug/kg	64.5	8.69	1	A
Aroclor 1248	ND		ug/kg	64.5	9.67	1	A
Aroclor 1254	ND		ug/kg	64.5	7.05	1	A
Aroclor 1260	ND		ug/kg	64.5	11.9	1	A
Aroclor 1262	ND		ug/kg	64.5	8.19	1	A
Aroclor 1268	ND		ug/kg	64.5	6.68	1	A
PCBs, Total	ND		ug/kg	64.5	5.72	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	80		30-150	A
Decachlorobiphenyl	72		30-150	A
2,4,5,6-Tetrachloro-m-xylene	77		30-150	B
Decachlorobiphenyl	66		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-07
Client ID: P6SB01_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 13:00
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/18/25 09:36
Analyst: AKM
Percent Solids: 95%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 22:46
Cleanup Method: EPA 3665A
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	48.5	4.31	1	A
Aroclor 1221	ND		ug/kg	48.5	4.86	1	A
Aroclor 1232	ND		ug/kg	48.5	10.3	1	A
Aroclor 1242	ND		ug/kg	48.5	6.54	1	A
Aroclor 1248	ND		ug/kg	48.5	7.28	1	A
Aroclor 1254	ND		ug/kg	48.5	5.31	1	A
Aroclor 1260	ND		ug/kg	48.5	8.97	1	A
Aroclor 1262	ND		ug/kg	48.5	6.16	1	A
Aroclor 1268	ND		ug/kg	48.5	5.03	1	A
PCBs, Total	ND		ug/kg	48.5	4.31	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	75		30-150	A
Decachlorobiphenyl	66		30-150	A
2,4,5,6-Tetrachloro-m-xylene	82		30-150	B
Decachlorobiphenyl	98		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-08
Client ID: P6SB01_5-6
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 13:45
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/18/25 09:44
Analyst: AKM
Percent Solids: 84%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 22:46
Cleanup Method: EPA 3665A
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	58.2	5.17	1	A
Aroclor 1221	ND		ug/kg	58.2	5.83	1	A
Aroclor 1232	ND		ug/kg	58.2	12.3	1	A
Aroclor 1242	ND		ug/kg	58.2	7.84	1	A
Aroclor 1248	ND		ug/kg	58.2	8.73	1	A
Aroclor 1254	ND		ug/kg	58.2	6.37	1	A
Aroclor 1260	ND		ug/kg	58.2	10.8	1	B
Aroclor 1262	ND		ug/kg	58.2	7.39	1	A
Aroclor 1268	ND		ug/kg	58.2	6.03	1	A
PCBs, Total	ND		ug/kg	58.2	5.17	1	B

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	77		30-150	A
Decachlorobiphenyl	70		30-150	A
2,4,5,6-Tetrachloro-m-xylene	77		30-150	B
Decachlorobiphenyl	63		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-09
Client ID: P6SB05_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 14:05
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/18/25 09:52
Analyst: AKM
Percent Solids: 92%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 22:46
Cleanup Method: EPA 3665A
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	52.3	4.64	1	A
Aroclor 1221	ND		ug/kg	52.3	5.24	1	A
Aroclor 1232	ND		ug/kg	52.3	11.1	1	A
Aroclor 1242	ND		ug/kg	52.3	7.05	1	A
Aroclor 1248	ND		ug/kg	52.3	7.84	1	A
Aroclor 1254	ND		ug/kg	52.3	5.72	1	A
Aroclor 1260	ND		ug/kg	52.3	9.66	1	A
Aroclor 1262	ND		ug/kg	52.3	6.64	1	A
Aroclor 1268	ND		ug/kg	52.3	5.42	1	A
PCBs, Total	ND		ug/kg	52.3	4.64	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	78		30-150	A
Decachlorobiphenyl	74		30-150	A
2,4,5,6-Tetrachloro-m-xylene	76		30-150	B
Decachlorobiphenyl	72		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-10
Client ID: P6SB05_5-6
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 14:30
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8082A
Analytical Date: 10/18/25 10:01
Analyst: AKM
Percent Solids: 84%

Extraction Method: EPA 3546
Extraction Date: 10/17/25 22:46
Cleanup Method: EPA 3665A
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/kg	56.1	4.98	1	A
Aroclor 1221	ND		ug/kg	56.1	5.62	1	A
Aroclor 1232	ND		ug/kg	56.1	11.9	1	A
Aroclor 1242	ND		ug/kg	56.1	7.56	1	A
Aroclor 1248	ND		ug/kg	56.1	8.42	1	A
Aroclor 1254	ND		ug/kg	56.1	6.14	1	A
Aroclor 1260	ND		ug/kg	56.1	10.4	1	A
Aroclor 1262	ND		ug/kg	56.1	7.13	1	A
Aroclor 1268	ND		ug/kg	56.1	5.81	1	A
PCBs, Total	ND		ug/kg	56.1	4.98	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	78		30-150	A
Decachlorobiphenyl	67		30-150	A
2,4,5,6-Tetrachloro-m-xylene	77		30-150	B
Decachlorobiphenyl	65		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8082A
Analytical Date: 10/18/25 08:05
Analyst: AKM

Extraction Method: EPA 3546
Extraction Date: 10/17/25 22:46
Cleanup Method: EPA 3665A
Cleanup Date: 10/18/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/18/25

Parameter	Result	Qualifier	Units	RL	MDL	Column
Polychlorinated Biphenyls by GC - Westborough Lab for sample(s): 01-10 Batch: WG2129445-1						
Aroclor 1016	ND		ug/kg	48.4	4.30	A
Aroclor 1221	ND		ug/kg	48.4	4.85	A
Aroclor 1232	ND		ug/kg	48.4	10.3	A
Aroclor 1242	ND		ug/kg	48.4	6.52	A
Aroclor 1248	ND		ug/kg	48.4	7.26	A
Aroclor 1254	ND		ug/kg	48.4	5.30	A
Aroclor 1260	ND		ug/kg	48.4	8.94	A
Aroclor 1262	ND		ug/kg	48.4	6.15	A
Aroclor 1268	ND		ug/kg	48.4	5.01	A
PCBs, Total	ND		ug/kg	48.4	4.30	A

Surrogate	%Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	86		30-150	A
Decachlorobiphenyl	74		30-150	A
2,4,5,6-Tetrachloro-m-xylene	85		30-150	B
Decachlorobiphenyl	71		30-150	B

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits	Column
Polychlorinated Biphenyls by GC - Westborough Lab Associated sample(s): 01-10 Batch: WG2129445-2 WG2129445-3									
Aroclor 1016	78		80		40-140	3		50	A
Aroclor 1260	80		82		40-140	2		50	A

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	87		91		30-150	A
Decachlorobiphenyl	76		77		30-150	A
2,4,5,6-Tetrachloro-m-xylene	86		87		30-150	B
Decachlorobiphenyl	73		74		30-150	B

PESTICIDES

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-01
Client ID: P6SB02_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 08:15
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8081B
Analytical Date: 10/19/25 16:42
Analyst: JAG
Percent Solids: 77%

Extraction Method: EPA 3546
Extraction Date: 10/18/25 02:45
Cleanup Method: EPA 3620B
Cleanup Date: 10/19/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/19/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							
Delta-BHC	ND		ug/kg	1.97	0.386	1	A
Lindane	ND		ug/kg	0.822	0.367	1	A
Alpha-BHC	ND		ug/kg	0.822	0.233	1	A
Beta-BHC	ND		ug/kg	1.97	0.748	1	A
Heptachlor	ND		ug/kg	0.986	0.442	1	A
Aldrin	ND		ug/kg	1.97	0.695	1	A
Heptachlor epoxide	ND		ug/kg	3.70	1.11	1	A
Endrin	ND		ug/kg	0.822	0.337	1	A
Endrin aldehyde	ND		ug/kg	2.47	0.863	1	A
Endrin ketone	ND		ug/kg	1.97	0.508	1	A
Dieldrin	ND		ug/kg	1.23	0.616	1	A
4,4'-DDE	ND		ug/kg	1.97	0.456	1	A
4,4'-DDD	ND		ug/kg	1.97	0.704	1	A
4,4'-DDT	ND		ug/kg	1.97	1.59	1	A
Endosulfan I	ND		ug/kg	1.97	0.466	1	A
Endosulfan II	ND		ug/kg	1.97	0.659	1	A
Endosulfan sulfate	ND		ug/kg	0.822	0.391	1	A
Methoxychlor	ND		ug/kg	3.70	1.15	1	A
Toxaphene	ND		ug/kg	37.0	10.4	1	A
cis-Chlordane	ND		ug/kg	2.47	0.687	1	A
trans-Chlordane	ND		ug/kg	2.47	0.651	1	A
Chlordane	ND		ug/kg	16.4	6.54	1	A

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-01 Date Collected: 10/16/25 08:15

Client ID: P6SB02_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	93		30-150	A
Decachlorobiphenyl	30		30-150	A
2,4,5,6-Tetrachloro-m-xylene	92		30-150	B
Decachlorobiphenyl	**1230**	Q	30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-01
Client ID: P6SB02_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 08:15
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8151A
Analytical Date: 10/20/25 09:24
Analyst: JAG
Percent Solids: 77%
Methylation Date: 10/20/25 02:35

Extraction Method: EPA 8151A
Extraction Date: 10/18/25 10:28

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Chlorinated Herbicides by GC - Westborough Lab							
2,4-D	ND		ug/kg	215	13.6	1	A
2,4,5-T	ND		ug/kg	215	6.68	1	A
2,4,5-TP (Silvex)	ND		ug/kg	215	5.73	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
DCAA	56		30-150	A
DCAA	48		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-03
Client ID: P6SB09_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 10:30
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8081B
Analytical Date: 10/19/25 16:54
Analyst: JAG
Percent Solids: 87%

Extraction Method: EPA 3546
Extraction Date: 10/18/25 02:45
Cleanup Method: EPA 3620B
Cleanup Date: 10/19/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/19/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							
Delta-BHC	ND		ug/kg	1.76	0.345	1	A
Lindane	ND		ug/kg	0.733	0.328	1	A
Alpha-BHC	ND		ug/kg	0.733	0.208	1	A
Beta-BHC	ND		ug/kg	1.76	0.667	1	A
Heptachlor	ND		ug/kg	0.880	0.394	1	A
Aldrin	ND		ug/kg	1.76	0.620	1	A
Heptachlor epoxide	ND		ug/kg	3.30	0.990	1	A
Endrin	ND		ug/kg	0.733	0.301	1	A
Endrin aldehyde	ND		ug/kg	2.20	0.770	1	A
Endrin ketone	ND		ug/kg	1.76	0.453	1	A
Dieldrin	ND		ug/kg	1.10	0.550	1	A
4,4'-DDE	2.18		ug/kg	1.76	0.407	1	A
4,4'-DDD	ND		ug/kg	1.76	0.628	1	A
4,4'-DDT	2.54		ug/kg	1.76	1.42	1	B
Endosulfan I	ND		ug/kg	1.76	0.416	1	A
Endosulfan II	ND		ug/kg	1.76	0.588	1	A
Endosulfan sulfate	ND		ug/kg	0.733	0.349	1	A
Methoxychlor	ND		ug/kg	3.30	1.03	1	A
Toxaphene	ND		ug/kg	33.0	9.24	1	A
cis-Chlordane	ND		ug/kg	2.20	0.613	1	A
trans-Chlordane	ND		ug/kg	2.20	0.581	1	A
Chlordane	ND		ug/kg	14.7	5.83	1	A

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-03 Date Collected: 10/16/25 10:30

Client ID: P6SB09_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	104		30-150	A
Decachlorobiphenyl	79		30-150	A
2,4,5,6-Tetrachloro-m-xylene	101		30-150	B
Decachlorobiphenyl	85		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-03
Client ID: P6SB09_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 10:30
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8151A
Analytical Date: 10/20/25 09:44
Analyst: JAG
Percent Solids: 87%
Methylation Date: 10/20/25 02:35

Extraction Method: EPA 8151A
Extraction Date: 10/18/25 10:28

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Chlorinated Herbicides by GC - Westborough Lab							
2,4-D	ND		ug/kg	191	12.0	1	A
2,4,5-T	ND		ug/kg	191	5.91	1	A
2,4,5-TP (Silvex)	ND		ug/kg	191	5.07	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
DCAA	74		30-150	A
DCAA	65		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-05
Client ID: P6SB08_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 09:20
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8081B
Analytical Date: 10/20/25 10:40
Analyst: PEG
Percent Solids: 84%

Extraction Method: EPA 3546
Extraction Date: 10/18/25 02:45
Cleanup Method: EPA 3620B
Cleanup Date: 10/19/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/19/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							
Delta-BHC	ND		ug/kg	1.87	0.366	1	A
Lindane	ND		ug/kg	0.779	0.348	1	A
Alpha-BHC	ND		ug/kg	0.779	0.221	1	A
Beta-BHC	ND		ug/kg	1.87	0.709	1	A
Heptachlor	ND		ug/kg	0.935	0.419	1	A
Aldrin	ND		ug/kg	1.87	0.658	1	A
Heptachlor epoxide	ND		ug/kg	3.51	1.05	1	A
Endrin	ND		ug/kg	0.779	0.320	1	A
Endrin aldehyde	ND		ug/kg	2.34	0.818	1	A
Endrin ketone	ND		ug/kg	1.87	0.482	1	A
Dieldrin	ND		ug/kg	1.17	0.584	1	A
4,4'-DDE	18.6		ug/kg	1.87	0.432	1	A
4,4'-DDD	ND		ug/kg	1.87	0.667	1	A
4,4'-DDT	22.4		ug/kg	1.87	1.50	1	A
Endosulfan I	ND		ug/kg	1.87	0.442	1	A
Endosulfan II	ND		ug/kg	1.87	0.625	1	A
Endosulfan sulfate	ND		ug/kg	0.779	0.371	1	A
Methoxychlor	ND		ug/kg	3.51	1.09	1	A
Toxaphene	ND		ug/kg	35.1	9.82	1	A
cis-Chlordane	ND	IP	ug/kg	2.34	0.652	1	B
trans-Chlordane	2.26	J	ug/kg	2.34	0.617	1	A
Chlordane	17.6	IP	ug/kg	15.6	6.20	1	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-05 Date Collected: 10/16/25 09:20

Client ID: P6SB08_0-1 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	113		30-150	A
Decachlorobiphenyl	73		30-150	A
2,4,5,6-Tetrachloro-m-xylene	102		30-150	B
Decachlorobiphenyl	84		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-05
Client ID: P6SB08_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 09:20
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8151A
Analytical Date: 10/20/25 10:03
Analyst: JAG
Percent Solids: 84%
Methylation Date: 10/20/25 02:35

Extraction Method: EPA 8151A
Extraction Date: 10/18/25 10:28

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Chlorinated Herbicides by GC - Westborough Lab							
2,4-D	ND		ug/kg	193	12.2	1	A
2,4,5-T	ND		ug/kg	193	5.99	1	A
2,4,5-TP (Silvex)	ND		ug/kg	193	5.14	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
DCAA	79		30-150	A
DCAA	68		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-07
Client ID: P6SB01_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 13:00
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8081B
Analytical Date: 10/20/25 10:53
Analyst: PEG
Percent Solids: 95%

Extraction Method: EPA 3546
Extraction Date: 10/18/25 02:45
Cleanup Method: EPA 3620B
Cleanup Date: 10/19/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/19/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							
Delta-BHC	ND		ug/kg	1.58	0.310	1	A
Lindane	ND		ug/kg	0.660	0.295	1	A
Alpha-BHC	ND		ug/kg	0.660	0.187	1	A
Beta-BHC	ND		ug/kg	1.58	0.601	1	A
Heptachlor	ND		ug/kg	0.792	0.355	1	A
Aldrin	ND		ug/kg	1.58	0.558	1	A
Heptachlor epoxide	4.19		ug/kg	2.97	0.891	1	A
Endrin	ND		ug/kg	0.660	0.271	1	A
Endrin aldehyde	ND		ug/kg	1.98	0.693	1	A
Endrin ketone	ND		ug/kg	1.58	0.408	1	A
Dieldrin	5.79		ug/kg	0.990	0.495	1	A
4,4'-DDE	15.6		ug/kg	1.58	0.366	1	A
4,4'-DDD	ND		ug/kg	1.58	0.565	1	A
4,4'-DDT	12.0		ug/kg	1.58	1.27	1	A
Endosulfan I	ND		ug/kg	1.58	0.374	1	A
Endosulfan II	ND		ug/kg	1.58	0.529	1	A
Endosulfan sulfate	ND		ug/kg	0.660	0.314	1	A
Methoxychlor	ND		ug/kg	2.97	0.924	1	A
Toxaphene	ND		ug/kg	29.7	8.32	1	A
cis-Chlordane	15.0	IP	ug/kg	1.98	0.552	1	B
trans-Chlordane	7.58		ug/kg	1.98	0.523	1	B
Chlordane	87.5		ug/kg	13.2	5.25	1	A

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-07 Date Collected: 10/16/25 13:00

Client ID: P6SB01_0-1 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	102		30-150	A
Decachlorobiphenyl	73		30-150	A
2,4,5,6-Tetrachloro-m-xylene	88		30-150	B
Decachlorobiphenyl	93		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-07
Client ID: P6SB01_0-1
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 13:00
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8151A
Analytical Date: 10/20/25 10:23
Analyst: JAG
Percent Solids: 95%
Methylation Date: 10/20/25 02:35

Extraction Method: EPA 8151A
Extraction Date: 10/18/25 11:12

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Chlorinated Herbicides by GC - Westborough Lab							
2,4-D	ND		ug/kg	173	10.9	1	A
2,4,5-T	ND		ug/kg	173	5.36	1	A
2,4,5-TP (Silvex)	ND		ug/kg	173	4.60	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
DCAA	74		30-150	A
DCAA	66		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-09
Client ID: P6SB05_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 14:05
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8081B
Analytical Date: 10/20/25 11:34
Analyst: PEG
Percent Solids: 92%

Extraction Method: EPA 3546
Extraction Date: 10/18/25 02:45
Cleanup Method: EPA 3620B
Cleanup Date: 10/19/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/19/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							
Delta-BHC	ND		ug/kg	1.69	0.331	1	A
Lindane	ND		ug/kg	0.704	0.314	1	A
Alpha-BHC	ND		ug/kg	0.704	0.200	1	A
Beta-BHC	ND		ug/kg	1.69	0.640	1	A
Heptachlor	ND		ug/kg	0.844	0.378	1	A
Aldrin	ND		ug/kg	1.69	0.595	1	A
Heptachlor epoxide	ND		ug/kg	3.17	0.950	1	A
Endrin	ND		ug/kg	0.704	0.288	1	A
Endrin aldehyde	ND		ug/kg	2.11	0.739	1	A
Endrin ketone	ND		ug/kg	1.69	0.435	1	A
Dieldrin	ND		ug/kg	1.06	0.528	1	A
4,4'-DDE	2.24		ug/kg	1.69	0.390	1	B
4,4'-DDD	ND		ug/kg	1.69	0.602	1	A
4,4'-DDT	2.52		ug/kg	1.69	1.36	1	B
Endosulfan I	ND		ug/kg	1.69	0.399	1	A
Endosulfan II	ND		ug/kg	1.69	0.564	1	A
Endosulfan sulfate	ND		ug/kg	0.704	0.335	1	A
Methoxychlor	ND		ug/kg	3.17	0.985	1	A
Toxaphene	ND		ug/kg	31.7	8.87	1	A
cis-Chlordane	ND		ug/kg	2.11	0.588	1	A
trans-Chlordane	ND		ug/kg	2.11	0.557	1	A
Chlordane	ND		ug/kg	14.1	5.59	1	A

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-09 Date Collected: 10/16/25 14:05

Client ID: P6SB05_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Organochlorine Pesticides by GC - Westborough Lab							

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	88		30-150	A
Decachlorobiphenyl	90		30-150	A
2,4,5,6-Tetrachloro-m-xylene	80		30-150	B
Decachlorobiphenyl	91		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Lab Number: L2565714
Project Number: 170859701
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-09
Client ID: P6SB05_1-2
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 14:05
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil
Analytical Method: 1,8151A
Analytical Date: 10/20/25 10:42
Analyst: JAG
Percent Solids: 92%
Methylation Date: 10/20/25 02:35

Extraction Method: EPA 8151A
Extraction Date: 10/18/25 11:12

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Chlorinated Herbicides by GC - Westborough Lab							
2,4-D	ND		ug/kg	180	11.3	1	A
2,4,5-T	ND		ug/kg	180	5.57	1	A
2,4,5-TP (Silvex)	ND		ug/kg	180	4.78	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
DCAA	75		30-150	A
DCAA	63		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8081B
Analytical Date: 10/19/25 15:56
Analyst: JAG

Extraction Method: EPA 3546
Extraction Date: 10/18/25 02:45
Cleanup Method: EPA 3620B
Cleanup Date: 10/19/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/19/25

Parameter	Result	Qualifier	Units	RL	MDL	Column
Organochlorine Pesticides by GC - Westborough Lab for sample(s): 01,03,05,07,09 Batch: WG2129480-1						
Delta-BHC	ND		ug/kg	1.53	0.299	A
Lindane	ND		ug/kg	0.636	0.284	A
Alpha-BHC	ND		ug/kg	0.636	0.181	A
Beta-BHC	ND		ug/kg	1.53	0.579	A
Heptachlor	ND		ug/kg	0.763	0.342	A
Aldrin	ND		ug/kg	1.53	0.538	A
Heptachlor epoxide	ND		ug/kg	2.86	0.859	A
Endrin	ND		ug/kg	0.636	0.261	A
Endrin aldehyde	ND		ug/kg	1.91	0.668	A
Endrin ketone	ND		ug/kg	1.53	0.393	A
Dieldrin	ND		ug/kg	0.954	0.477	A
4,4'-DDE	ND		ug/kg	1.53	0.353	A
4,4'-DDD	ND		ug/kg	1.53	0.544	A
4,4'-DDT	ND		ug/kg	1.53	1.23	A
Endosulfan I	ND		ug/kg	1.53	0.361	A
Endosulfan II	ND		ug/kg	1.53	0.510	A
Endosulfan sulfate	ND		ug/kg	0.636	0.303	A
Methoxychlor	ND		ug/kg	2.86	0.890	A
Toxaphene	ND		ug/kg	28.6	8.02	A
cis-Chlordane	ND		ug/kg	1.91	0.532	A
trans-Chlordane	ND		ug/kg	1.91	0.504	A
Chlordane	ND		ug/kg	12.7	5.06	A

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8081B
Analytical Date: 10/19/25 15:56
Analyst: JAG

Extraction Method: EPA 3546
Extraction Date: 10/18/25 02:45
Cleanup Method: EPA 3620B
Cleanup Date: 10/19/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/19/25

Parameter	Result	Qualifier	Units	RL	MDL	Column
Organochlorine Pesticides by GC - Westborough Lab for sample(s): 01,03,05,07,09 Batch: WG2129480-1						

Surrogate	%Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	96		30-150	A
Decachlorobiphenyl	117		30-150	A
2,4,5,6-Tetrachloro-m-xylene	99		30-150	B
Decachlorobiphenyl	120		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8151A
Analytical Date: 10/20/25 08:17
Analyst: AKM

Extraction Method: EPA 8151A
Extraction Date: 10/18/25 09:03

Methylation Date: 10/20/25 02:35

Parameter	Result	Qualifier	Units	RL	MDL	Column
Chlorinated Herbicides by GC - Westborough Lab for sample(s): 01,03,05,07,09 Batch: WG2129587-1						
2,4-D	ND		ug/kg	167	10.5	A
2,4,5-T	ND		ug/kg	167	5.17	A
2,4,5-TP (Silvex)	ND		ug/kg	167	4.43	A

Surrogate	%Recovery	Qualifier	Acceptance Criteria	Column
DCAA	72		30-150	A
DCAA	80		30-150	B

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits	Column
Organochlorine Pesticides by GC - Westborough Lab Associated sample(s): 01,03,05,07,09 Batch: WG2129480-2 WG2129480-3									
Delta-BHC	99		97		30-150	2		30	A
Lindane	105		101		30-150	4		30	A
Alpha-BHC	98		95		30-150	3		30	A
Beta-BHC	105		103		30-150	2		30	A
Heptachlor	110		104		30-150	6		30	A
Aldrin	100		98		30-150	2		30	A
Heptachlor epoxide	95		89		30-150	7		30	A
Endrin	110		108		30-150	2		30	A
Endrin aldehyde	96		95		30-150	1		30	A
Endrin ketone	112		110		30-150	2		30	A
Dieldrin	103		101		30-150	2		30	A
4,4'-DDE	98		95		30-150	3		30	A
4,4'-DDD	108		106		30-150	2		30	A
4,4'-DDT	113		112		30-150	1		30	A
Endosulfan I	101		99		30-150	2		30	A
Endosulfan II	123		122		30-150	1		30	A
Endosulfan sulfate	102		101		30-150	1		30	A
Methoxychlor	125		124		30-150	1		30	A
cis-Chlordane	90		89		30-150	1		30	A

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits	
Organochlorine Pesticides by GC - Westborough Lab Associated sample(s): 01,03,05,07,09 Batch: WG2129480-2 WG2129480-3									
trans-Chlordane	96		95		30-150	1		30	A

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	95		92		30-150	A
Decachlorobiphenyl	110		113		30-150	A
2,4,5,6-Tetrachloro-m-xylene	97		93		30-150	B
Decachlorobiphenyl	118		116		30-150	B

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits	Column
Chlorinated Herbicides by GC - Westborough Lab Associated sample(s): 01,03,05,07,09 Batch: WG2129587-2 WG2129587-3									
2,4-D	79		77		30-150	3		30	A
2,4,5-T	82		79		30-150	4		30	A
2,4,5-TP (Silvex)	76		74		30-150	3		30	A

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria	Column
DCAA	80		76		30-150	A
DCAA	93		95		30-150	B

METALS

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-01 Date Collected: 10/16/25 08:15

Client ID: P6SB02_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 77%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	9700		mg/kg	24.7	8.04	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	12.4	9.52	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Arsenic, Total	9.68		mg/kg	2.47	1.07	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Barium, Total	102		mg/kg	2.47	0.262	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.387	J	mg/kg	1.24	0.136	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.345	J	mg/kg	2.47	0.136	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Calcium, Total	80600		mg/kg	24.7	14.0	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Chromium, Total	20.8		mg/kg	2.47	2.10	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Cobalt, Total	15.2		mg/kg	4.95	0.613	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Copper, Total	60.4		mg/kg	2.47	0.561	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Iron, Total	63000		mg/kg	12.4	2.60	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Lead, Total	23.8		mg/kg	12.4	0.589	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Magnesium, Total	19000		mg/kg	24.7	4.03	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Manganese, Total	624		mg/kg	2.47	1.32	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Mercury, Total	ND		mg/kg	0.085	0.055	1	10/21/25 16:47	10/21/25 22:37	EPA 7471B	1,7471B	RDB
Nickel, Total	50.7		mg/kg	6.18	2.00	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Potassium, Total	1040		mg/kg	618	125.	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	4.95	0.814	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	1.24	0.737	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Sodium, Total	354	J	mg/kg	495	262.	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	4.95	2.23	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Vanadium, Total	20.2		mg/kg	2.47	0.374	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
Zinc, Total	61.1		mg/kg	12.4	1.50	5	10/21/25 16:39	10/23/25 13:23	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	20.8		mg/kg	2.47	2.10	1		10/23/25 13:23	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-02 Date Collected: 10/16/25 08:45

Client ID: P6SB02_3-4 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 82%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	14300		mg/kg	9.21	2.99	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.61	3.55	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Arsenic, Total	3.44		mg/kg	0.921	0.398	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Barium, Total	58.9		mg/kg	0.921	0.098	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.674		mg/kg	0.461	0.051	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.122	J	mg/kg	0.921	0.051	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Calcium, Total	11200		mg/kg	9.21	5.22	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Chromium, Total	20.8		mg/kg	0.921	0.781	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Cobalt, Total	13.1		mg/kg	1.84	0.228	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Copper, Total	22.6		mg/kg	0.921	0.209	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Iron, Total	23200		mg/kg	4.61	0.967	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Lead, Total	17.2		mg/kg	4.61	0.219	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Magnesium, Total	8520		mg/kg	9.21	1.50	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Manganese, Total	204		mg/kg	0.921	0.494	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Mercury, Total	ND		mg/kg	0.096	0.062	1	10/21/25 16:47	10/21/25 22:46	EPA 7471B	1,7471B	RDB
Nickel, Total	33.5		mg/kg	2.30	0.744	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Potassium, Total	829		mg/kg	230	46.7	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	1.84	0.303	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.461	0.274	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Sodium, Total	397		mg/kg	184	97.6	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.84	0.831	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Vanadium, Total	28.8		mg/kg	0.921	0.139	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
Zinc, Total	65.9		mg/kg	4.61	0.558	2	10/21/25 16:39	10/23/25 12:00	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	20.8		mg/kg	0.978	0.781	1		10/23/25 12:00	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-03 Date Collected: 10/16/25 10:30

Client ID: P6SB09_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 87%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	8810		mg/kg	8.69	2.82	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.34	3.34	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Arsenic, Total	9.21		mg/kg	0.869	0.375	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Barium, Total	274		mg/kg	0.869	0.092	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.486		mg/kg	0.434	0.048	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.410	J	mg/kg	0.869	0.048	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Calcium, Total	29000		mg/kg	8.69	4.92	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Chromium, Total	12.9		mg/kg	0.869	0.737	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Cobalt, Total	7.56		mg/kg	1.74	0.215	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Copper, Total	85.9		mg/kg	0.869	0.197	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Iron, Total	11500		mg/kg	4.34	0.912	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Lead, Total	938		mg/kg	4.34	0.207	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Magnesium, Total	8700		mg/kg	8.69	1.42	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Manganese, Total	230		mg/kg	0.869	0.466	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Mercury, Total	0.837		mg/kg	0.095	0.062	1	10/21/25 16:47	10/21/25 22:49	EPA 7471B	1,7471B	RDB
Nickel, Total	19.8		mg/kg	2.17	0.702	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Potassium, Total	892		mg/kg	217	44.0	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	1.74	0.286	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Silver, Total	0.292	J	mg/kg	0.434	0.259	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Sodium, Total	238		mg/kg	174	92.1	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.74	0.784	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Vanadium, Total	22.7		mg/kg	0.869	0.131	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
Zinc, Total	213		mg/kg	4.34	0.526	2	10/21/25 16:39	10/23/25 12:05	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	12.9		mg/kg	0.917	0.737	1		10/23/25 12:05	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-04 Date Collected: 10/16/25 10:45

Client ID: P6SB09_3-4 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 85%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	10900		mg/kg	8.93	2.90	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.46	3.44	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Arsenic, Total	3.14		mg/kg	0.893	0.386	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Barium, Total	69.4		mg/kg	0.893	0.095	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.505		mg/kg	0.446	0.049	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.143	J	mg/kg	0.893	0.049	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Calcium, Total	15300		mg/kg	8.93	5.06	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Chromium, Total	16.5		mg/kg	0.893	0.757	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Cobalt, Total	9.86		mg/kg	1.78	0.221	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Copper, Total	23.4		mg/kg	0.893	0.203	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Iron, Total	16600		mg/kg	4.46	0.937	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Lead, Total	62.4		mg/kg	4.46	0.212	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Magnesium, Total	9150		mg/kg	8.93	1.46	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Manganese, Total	185		mg/kg	0.893	0.478	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Mercury, Total	ND		mg/kg	0.079	0.052	1	10/21/25 16:47	10/21/25 22:52	EPA 7471B	1,7471B	RDB
Nickel, Total	26.8		mg/kg	2.23	0.721	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Potassium, Total	678		mg/kg	223	45.2	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	1.78	0.294	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.446	0.266	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Sodium, Total	ND		mg/kg	178	94.6	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.78	0.805	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Vanadium, Total	19.2		mg/kg	0.893	0.135	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
Zinc, Total	69.3		mg/kg	4.46	0.541	2	10/21/25 16:39	10/23/25 12:10	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	16.5		mg/kg	0.943	0.757	1		10/23/25 12:10	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-05 Date Collected: 10/16/25 09:20

Client ID: P6SB08_0-1 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 84%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	7810		mg/kg	9.03	2.94	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.52	3.48	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Arsenic, Total	8.53		mg/kg	0.903	0.390	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Barium, Total	235		mg/kg	0.903	0.096	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.446	J	mg/kg	0.452	0.050	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Cadmium, Total	1.18		mg/kg	0.903	0.050	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Calcium, Total	33700		mg/kg	9.03	5.12	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Chromium, Total	15.2		mg/kg	0.903	0.766	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Cobalt, Total	7.90		mg/kg	1.81	0.224	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Copper, Total	53.9		mg/kg	0.903	0.205	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Iron, Total	11100		mg/kg	4.52	0.949	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Lead, Total	176		mg/kg	4.52	0.215	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Magnesium, Total	5090		mg/kg	9.03	1.47	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Manganese, Total	394		mg/kg	0.903	0.484	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Mercury, Total	0.213		mg/kg	0.084	0.055	1	10/21/25 16:47	10/21/25 22:55	EPA 7471B	1,7471B	RDB
Nickel, Total	29.6		mg/kg	2.26	0.730	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Potassium, Total	899		mg/kg	226	45.8	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	1.81	0.297	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.452	0.269	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Sodium, Total	110	J	mg/kg	181	95.8	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.81	0.815	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Vanadium, Total	22.4		mg/kg	0.903	0.136	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
Zinc, Total	195		mg/kg	4.52	0.547	2	10/21/25 16:39	10/23/25 13:12	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	15.2		mg/kg	0.949	0.766	1		10/23/25 13:12	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-06 Date Collected: 10/16/25 09:40

Client ID: P6SB08_2-3 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 73%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	8350		mg/kg	10.4	3.40	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	5.22	4.02	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Arsenic, Total	6.35		mg/kg	1.04	0.451	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Barium, Total	107		mg/kg	1.04	0.111	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.430	J	mg/kg	0.522	0.058	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.325	J	mg/kg	1.04	0.058	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Calcium, Total	73900		mg/kg	20.9	11.8	4	10/21/25 16:39	10/24/25 11:02	EPA 3050B	1,6010D	EFM
Chromium, Total	14.7		mg/kg	1.04	0.886	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Cobalt, Total	8.32		mg/kg	2.09	0.259	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Copper, Total	46.9		mg/kg	1.04	0.237	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Iron, Total	12300		mg/kg	5.22	1.10	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Lead, Total	278		mg/kg	5.22	0.249	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Magnesium, Total	26900		mg/kg	10.4	1.70	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Manganese, Total	373		mg/kg	1.04	0.560	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Mercury, Total	0.319		mg/kg	0.086	0.056	1	10/21/25 16:47	10/21/25 22:58	EPA 7471B	1,7471B	RDB
Nickel, Total	21.2		mg/kg	2.61	0.844	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Potassium, Total	1100		mg/kg	261	53.0	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	2.09	0.344	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.522	0.311	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Sodium, Total	350		mg/kg	209	111.	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	2.09	0.942	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Vanadium, Total	17.9		mg/kg	1.04	0.158	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
Zinc, Total	170		mg/kg	5.22	0.633	2	10/21/25 16:39	10/23/25 13:17	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	14.7		mg/kg	1.10	0.886	1		10/23/25 13:17	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-07 Date Collected: 10/16/25 13:00

Client ID: P6SB01_0-1 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 95%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	7010		mg/kg	8.03	2.61	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.01	3.09	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Arsenic, Total	4.22		mg/kg	0.803	0.347	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Barium, Total	91.8		mg/kg	0.803	0.085	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.342	J	mg/kg	0.401	0.044	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.319	J	mg/kg	0.803	0.044	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Calcium, Total	76600		mg/kg	16.0	9.10	4	10/21/25 16:39	10/24/25 11:07	EPA 3050B	1,6010D	EFM
Chromium, Total	10.3		mg/kg	0.803	0.681	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Cobalt, Total	6.68		mg/kg	1.60	0.199	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Copper, Total	24.0		mg/kg	0.803	0.182	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Iron, Total	15600		mg/kg	8.03	1.68	4	10/21/25 16:39	10/24/25 11:07	EPA 3050B	1,6010D	EFM
Lead, Total	49.8		mg/kg	4.01	0.191	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Magnesium, Total	11800		mg/kg	8.03	1.31	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Manganese, Total	368		mg/kg	0.803	0.430	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Mercury, Total	0.081	J	mg/kg	0.084	0.055	1	10/21/25 16:47	10/21/25 23:07	EPA 7471B	1,7471B	RDB
Nickel, Total	19.6		mg/kg	2.01	0.648	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Potassium, Total	840		mg/kg	201	40.7	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	1.60	0.264	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.401	0.239	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Sodium, Total	90.1	J	mg/kg	160	85.1	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.60	0.724	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Vanadium, Total	15.4		mg/kg	0.803	0.121	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
Zinc, Total	68.8		mg/kg	4.01	0.486	2	10/21/25 16:39	10/23/25 14:06	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	10.3		mg/kg	0.841	0.681	1		10/23/25 14:06	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-08 Date Collected: 10/16/25 13:45

Client ID: P6SB01_5-6 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 84%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	11700		mg/kg	9.21	2.99	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.61	3.55	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Arsenic, Total	1.01		mg/kg	0.921	0.398	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Barium, Total	110		mg/kg	0.921	0.098	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.419	J	mg/kg	0.461	0.051	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.124	J	mg/kg	0.921	0.051	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Calcium, Total	32500		mg/kg	9.21	5.22	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Chromium, Total	15.7		mg/kg	0.921	0.781	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Cobalt, Total	9.02		mg/kg	1.84	0.228	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Copper, Total	21.0		mg/kg	0.921	0.209	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Iron, Total	17300		mg/kg	4.61	0.967	2	10/21/25 16:39	10/24/25 11:12	EPA 3050B	1,6010D	EFM
Lead, Total	8.48		mg/kg	4.61	0.219	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Magnesium, Total	16300		mg/kg	9.21	1.50	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Manganese, Total	203		mg/kg	0.921	0.494	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Mercury, Total	ND		mg/kg	0.093	0.061	1	10/21/25 16:47	10/21/25 23:10	EPA 7471B	1,7471B	RDB
Nickel, Total	25.0		mg/kg	2.30	0.744	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Potassium, Total	815		mg/kg	230	46.7	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	1.84	0.303	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.461	0.274	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Sodium, Total	ND		mg/kg	184	97.7	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.84	0.831	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Vanadium, Total	18.1		mg/kg	0.921	0.139	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
Zinc, Total	51.4		mg/kg	4.61	0.558	2	10/21/25 16:39	10/23/25 14:12	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	15.7		mg/kg	0.948	0.781	1		10/23/25 14:12	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-09 Date Collected: 10/16/25 14:05

Client ID: P6SB05_1-2 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 92%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	5940		mg/kg	8.58	2.79	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.29	3.30	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Arsenic, Total	7.53		mg/kg	0.858	0.371	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Barium, Total	587		mg/kg	0.858	0.091	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.344	J	mg/kg	0.429	0.047	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.769	J	mg/kg	0.858	0.047	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Calcium, Total	65700		mg/kg	17.2	9.73	4	10/21/25 16:39	10/24/25 11:17	EPA 3050B	1,6010D	EFM
Chromium, Total	14.5		mg/kg	0.858	0.728	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Cobalt, Total	8.33		mg/kg	1.72	0.213	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Copper, Total	198		mg/kg	0.858	0.195	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Iron, Total	19700		mg/kg	8.58	1.80	4	10/21/25 16:39	10/24/25 11:17	EPA 3050B	1,6010D	EFM
Lead, Total	1600		mg/kg	4.29	0.204	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Magnesium, Total	12000		mg/kg	8.58	1.40	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Manganese, Total	333		mg/kg	0.858	0.460	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Mercury, Total	0.868		mg/kg	0.086	0.056	1	10/21/25 16:47	10/21/25 23:13	EPA 7471B	1,7471B	RDB
Nickel, Total	19.6		mg/kg	2.15	0.694	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Potassium, Total	633		mg/kg	215	43.5	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	1.72	0.282	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.429	0.256	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Sodium, Total	147	J	mg/kg	172	91.0	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.72	0.774	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Vanadium, Total	15.8		mg/kg	0.858	0.130	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
Zinc, Total	653		mg/kg	4.29	0.520	2	10/21/25 16:39	10/23/25 14:17	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	14.5		mg/kg	0.871	0.728	1		10/23/25 14:17	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-10 Date Collected: 10/16/25 14:30

Client ID: P6SB05_5-6 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Soil

Percent Solids: 84%

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	8770		mg/kg	9.12	2.96	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Antimony, Total	ND		mg/kg	4.56	3.51	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Arsenic, Total	3.04		mg/kg	0.912	0.394	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Barium, Total	73.7		mg/kg	0.912	0.097	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Beryllium, Total	0.346	J	mg/kg	0.456	0.050	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Cadmium, Total	0.180	J	mg/kg	0.912	0.050	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Calcium, Total	81300		mg/kg	18.2	10.3	4	10/21/25 16:39	10/24/25 11:23	EPA 3050B	1,6010D	EFM
Chromium, Total	12.0		mg/kg	0.912	0.773	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Cobalt, Total	8.41		mg/kg	1.82	0.226	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Copper, Total	21.4		mg/kg	0.912	0.207	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Iron, Total	15600		mg/kg	9.12	1.92	4	10/21/25 16:39	10/24/25 11:23	EPA 3050B	1,6010D	EFM
Lead, Total	22.5		mg/kg	4.56	0.217	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Magnesium, Total	15200		mg/kg	9.12	1.49	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Manganese, Total	268		mg/kg	0.912	0.489	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Mercury, Total	ND		mg/kg	0.082	0.054	1	10/21/25 16:47	10/21/25 23:16	EPA 7471B	1,7471B	RDB
Nickel, Total	20.8		mg/kg	2.28	0.737	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Potassium, Total	705		mg/kg	228	46.2	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Selenium, Total	ND		mg/kg	1.82	0.300	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.456	0.272	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Sodium, Total	310		mg/kg	182	96.7	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Thallium, Total	ND		mg/kg	1.82	0.822	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Vanadium, Total	15.0		mg/kg	0.912	0.138	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
Zinc, Total	48.9		mg/kg	4.56	0.553	2	10/21/25 16:39	10/23/25 14:22	EPA 3050B	1,6010D	ZPC
General Chemistry - Mansfield Lab											
Chromium, Trivalent	12.0		mg/kg	0.954	0.773	1		10/23/25 14:22	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Total Metals - Mansfield Lab for sample(s): 01-10 Batch: WG2130788-1										
Aluminum, Total	ND		mg/kg	4.00	1.30	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Antimony, Total	ND		mg/kg	2.00	1.54	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Arsenic, Total	ND		mg/kg	0.400	0.173	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Barium, Total	ND		mg/kg	0.400	0.042	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Beryllium, Total	ND		mg/kg	0.200	0.022	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Cadmium, Total	ND		mg/kg	0.400	0.022	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Calcium, Total	ND		mg/kg	4.00	2.27	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Chromium, Total	ND		mg/kg	0.400	0.339	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Cobalt, Total	ND		mg/kg	0.800	0.099	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Copper, Total	ND		mg/kg	0.400	0.091	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Iron, Total	1.06	J	mg/kg	2.00	0.420	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Lead, Total	ND		mg/kg	2.00	0.095	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Magnesium, Total	ND		mg/kg	4.00	0.652	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Manganese, Total	ND		mg/kg	0.400	0.214	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Nickel, Total	ND		mg/kg	1.00	0.323	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Potassium, Total	ND		mg/kg	100	20.3	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Selenium, Total	ND		mg/kg	0.800	0.132	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Silver, Total	ND		mg/kg	0.200	0.119	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Sodium, Total	ND		mg/kg	80.0	42.4	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Thallium, Total	ND		mg/kg	0.800	0.361	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Vanadium, Total	ND		mg/kg	0.400	0.060	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC
Zinc, Total	ND		mg/kg	2.00	0.242	1	10/21/25 16:39	10/23/25 12:56	1,6010D	ZPC

Prep Information

Digestion Method: EPA 3050B

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Total Metals - Mansfield Lab for sample(s): 01-10 Batch: WG2130790-1										
Mercury, Total	ND		mg/kg	0.083	0.054	1	10/21/25 16:47	10/21/25 22:32	1,7471B	RDB

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Prep Information

Digestion Method: EPA 7471B

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-10 Batch: WG2130788-2								
Aluminum, Total	104		-		80-120	-		20
Antimony, Total	102		-		80-120	-		20
Arsenic, Total	102		-		80-120	-		20
Barium, Total	101		-		80-120	-		20
Beryllium, Total	98		-		80-120	-		20
Cadmium, Total	100		-		80-120	-		20
Calcium, Total	96		-		80-120	-		20
Chromium, Total	101		-		80-120	-		20
Cobalt, Total	100		-		80-120	-		20
Copper, Total	98		-		80-120	-		20
Iron, Total	94		-		80-120	-		20
Lead, Total	104		-		80-120	-		20
Magnesium, Total	103		-		80-120	-		20
Manganese, Total	95		-		80-120	-		20
Nickel, Total	104		-		80-120	-		20
Potassium, Total	104		-		80-120	-		20
Selenium, Total	100		-		80-120	-		20
Silver, Total	97		-		80-120	-		20
Sodium, Total	101		-		80-120	-		20
Thallium, Total	105		-		80-120	-		20
Vanadium, Total	106		-		80-120	-		20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	LCSD %Recovery	%Recovery Limits	RPD	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-10 Batch: WG2130788-2					
Zinc, Total	104	-	80-120	-	20
Total Metals - Mansfield Lab Associated sample(s): 01-10 Batch: WG2130790-2					
Mercury, Total	95	-	80-120	-	20

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-10 QC Batch ID: WG2130788-3 QC Sample: L2565714-01 Client ID: P6SB02_1-2												
Aluminum, Total	9700	206	13500	**1840**	Q	-	-		75-125	-		
Antimony, Total	ND	51.5	24.3	**47**	Q	-	-		75-125	-		
Arsenic, Total	9.68	12.4	14.1	**36**	Q	-	-		75-125	-		
Barium, Total	102	206	304	98		-	-		75-125	-		
Beryllium, Total	0.387J	5.15	5.37	104		-	-		75-125	-		
Cadmium, Total	0.345J	5.46	5.67	104		-	-		75-125	-		
Calcium, Total	80600	1030	56900	**0**	Q	-	-		75-125	-		
Chromium, Total	20.8	20.6	39.9	93		-	-		75-125	-		
Cobalt, Total	15.2	51.5	62.7	92		-	-		75-125	-		
Copper, Total	60.4	25.8	52.7	**0**	Q	-	-		75-125	-		
Iron, Total	63000	103	24200	**0**	Q	-	-		75-125	-		
Lead, Total	23.8	54.6	74.4	93		-	-		75-125	-		
Magnesium, Total	19000	1030	23800	**466**	Q	-	-		75-125	-		
Manganese, Total	624	51.5	399	**0**	Q	-	-		75-125	-		
Nickel, Total	50.7	51.5	85.3	**67**	Q	-	-		75-125	-		
Potassium, Total	1040	1030	2140	107		-	-		75-125	-		
Selenium, Total	ND	12.4	10.6	86		-	-		75-125	-		
Silver, Total	ND	5.15	4.36	84		-	-		75-125	-		
Sodium, Total	354J	1030	1460	**142**	Q	-	-		75-125	-		

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-10 QC Batch ID: WG2130788-3 QC Sample: L2565714-01 Client ID: P6SB02_1-2												
Thallium, Total	ND	12.4	11.5	93		-	-		75-125	-		
Vanadium, Total	20.2	51.5	77.1	110		-	-		75-125	-		
Zinc, Total	61.1	51.5	127	**128**	Q	-	-		75-125	-		
Total Metals - Mansfield Lab Associated sample(s): 01-10 QC Batch ID: WG2130790-3 QC Sample: L2565714-01 Client ID: P6SB02_1-2												
Mercury, Total	ND	1.74	1.60	92		-	-		80-120	-		

Lab Duplicate Analysis

Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI

Project Number: 170859701

Lab Number: L2565714

Report Date: 10/30/25

Parameter	Native Sample	Duplicate Sample	Units	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-10 QC Batch ID: WG2130788-4 QC Sample: L2565714-01 Client ID: P6SB02_1-2						
Aluminum, Total	9700	13300	mg/kg	**31**	Q	20
Antimony, Total	ND	ND	mg/kg	NC		20
Arsenic, Total	9.68	2.66	mg/kg	**114**	Q	20
Barium, Total	102	108	mg/kg	6		20
Beryllium, Total	0.387J	0.520J	mg/kg	NC		20
Cadmium, Total	0.345J	0.188J	mg/kg	NC		20
Calcium, Total	80600	54900	mg/kg	**38**	Q	20
Chromium, Total	20.8	20.4	mg/kg	2		20
Cobalt, Total	15.2	12.6	mg/kg	19		20
Copper, Total	60.4	28.6	mg/kg	**71**	Q	20
Iron, Total	63000	21100	mg/kg	**100**	Q	20
Lead, Total	23.8	49.4	mg/kg	**70**	Q	20
Magnesium, Total	19000	21700	mg/kg	13		20
Manganese, Total	624	346	mg/kg	**57**	Q	20
Nickel, Total	50.7	32.8	mg/kg	**43**	Q	20
Potassium, Total	1040	1250	mg/kg	18		20
Selenium, Total	ND	ND	mg/kg	NC		20

Lab Duplicate Analysis

Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI

Project Number: 170859701

Lab Number: L2565714

Report Date: 10/30/25

Parameter	Native Sample	Duplicate Sample	Units	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-10 QC Batch ID: WG2130788-4 QC Sample: L2565714-01 Client ID: P6SB02_1-2						
Silver, Total	ND	ND	mg/kg	NC		20
Sodium, Total	354J	417J	mg/kg	NC		20
Thallium, Total	ND	ND	mg/kg	NC		20
Vanadium, Total	20.2	25.7	mg/kg	**24**	Q	20
Zinc, Total	61.1	93.7	mg/kg	**42**	Q	20
Total Metals - Mansfield Lab Associated sample(s): 01-10 QC Batch ID: WG2130790-4 QC Sample: L2565714-01 Client ID: P6SB02_1-2						
Mercury, Total	ND	ND	mg/kg	NC		20

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Serial Dilution Analysis
Batch Quality Control

Lab Number: L2565714
Report Date: 10/30/25

Parameter	Native Sample	Serial Dilution	Units	% D	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01-10 QC Batch ID: WG2130788-6 QC Sample: L2565714-01 Client ID: P6SB02_1-2						
Aluminum, Total	9700	9770	mg/kg	1		20
Barium, Total	102	104	mg/kg	2		20
Calcium, Total	80600	84200	mg/kg	4		20
Iron, Total	63000	73800	mg/kg	17		20
Magnesium, Total	19000	20800	mg/kg	9		20
Manganese, Total	624	647	mg/kg	4		20

INORGANICS
&
MISCELLANEOUS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-01
Client ID: P6SB02_1-2
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/16/25 08:15
Date Received: 10/16/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	76.8		%	0.100	NA	1	-	10/18/25 13:13	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.2	0.25	1	10/21/25 23:50	10/22/25 14:58	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	1.04	0.208	1	10/20/25 00:23	10/20/25 05:29	1,7196A	DTH

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-02
Client ID: P6SB02_3-4
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/16/25 08:45
Date Received: 10/16/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	81.8		%	0.100	NA	1	-	10/18/25 12:02	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.1	0.24	1	10/21/25 23:50	10/22/25 14:59	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.978	0.196	1	10/20/25 00:23	10/20/25 05:29	1,7196A	DTH

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-03
Client ID: P6SB09_1-2
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/16/25 10:30
Date Received: 10/16/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	87.2		%	0.100	NA	1	-	10/18/25 13:13	121,2540G	ROI
Cyanide, Total	0.28	J	mg/kg	1.1	0.23	1	10/21/25 23:50	10/22/25 15:00	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.917	0.183	1	10/20/25 00:23	10/20/25 05:29	1,7196A	DTH

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-04
Client ID: P6SB09_3-4
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/16/25 10:45
Date Received: 10/16/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	84.8		%	0.100	NA	1	-	10/18/25 13:13	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.1	0.23	1	10/22/25 19:50	10/23/25 13:09	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.943	0.189	1	10/20/25 00:23	10/20/25 05:29	1,7196A	DTH

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-05
Client ID: P6SB08_0-1
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/16/25 09:20
Date Received: 10/16/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	84.3		%	0.100	NA	1	-	10/18/25 13:13	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.1	0.24	1	10/22/25 19:50	10/23/25 13:10	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.949	0.190	1	10/20/25 00:23	10/20/25 05:29	1,7196A	DTH

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-06
Client ID: P6SB08_2-3
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/16/25 09:40
Date Received: 10/16/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	72.9		%	0.100	NA	1	-	10/18/25 13:13	121,2540G	ROI
Cyanide, Total	0.33	J	mg/kg	1.3	0.28	1	10/22/25 19:50	10/23/25 13:11	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	1.10	0.219	1	10/20/25 00:23	10/20/25 05:29	1,7196A	DTH

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-07
Client ID: P6SB01_0-1
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/16/25 13:00
Date Received: 10/16/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	95.1		%	0.100	NA	1	-	10/18/25 13:13	121,2540G	ROI
Cyanide, Total	0.22	J	mg/kg	0.96	0.20	1	10/22/25 19:50	10/23/25 13:12	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.841	0.168	1	10/20/25 00:23	10/20/25 05:29	1,7196A	DTH

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-08
Client ID: P6SB01_5-6
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/16/25 13:45
Date Received: 10/16/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	84.4		%	0.100	NA	1	-	10/18/25 13:13	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.1	0.23	1	10/22/25 19:50	10/23/25 13:13	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.948	0.190	1	10/20/25 00:23	10/20/25 05:29	1,7196A	DTH

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-09
Client ID: P6SB05_1-2
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/16/25 14:05
Date Received: 10/16/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	91.8		%	0.100	NA	1	-	10/18/25 13:13	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.0	0.21	1	10/22/25 19:50	10/23/25 13:14	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.871	0.174	1	10/20/25 00:23	10/20/25 05:29	1,7196A	DTH

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565714-10
Client ID: P6SB05_5-6
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Soil
Date Collected: 10/16/25 14:30
Date Received: 10/16/25
Field Prep: Not Specified

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Solids, Total	83.9		%	0.100	NA	1	-	10/18/25 13:13	121,2540G	ROI
Cyanide, Total	ND		mg/kg	1.2	0.25	1	10/22/25 19:50	10/23/25 13:17	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/kg	0.954	0.191	1	10/20/25 00:23	10/20/25 05:29	1,7196A	DTH

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab for sample(s): 01-10 Batch: WG2129897-1										
Chromium, Hexavalent	ND		mg/kg	0.800	0.160	1	10/20/25 00:23	10/20/25 05:29	1,7196A	DTH
General Chemistry - Westborough Lab for sample(s): 01-03 Batch: WG2130920-1										
Cyanide, Total	ND		mg/kg	0.96	0.20	1	10/21/25 23:50	10/22/25 14:52	1,9010C/9012B	JER
General Chemistry - Westborough Lab for sample(s): 04-10 Batch: WG2131447-1										
Cyanide, Total	ND		mg/kg	0.93	0.20	1	10/22/25 19:50	10/23/25 13:05	1,9010C/9012B	JER

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
General Chemistry - Westborough Lab Associated sample(s): 01-10 Batch: WG2129897-2								
Chromium, Hexavalent	104		-		80-120	-		
General Chemistry - Westborough Lab Associated sample(s): 01-03 Batch: WG2130920-2 WG2130920-3								
Cyanide, Total	84		89		80-120	6		35
General Chemistry - Westborough Lab Associated sample(s): 04-10 Batch: WG2131447-2 WG2131447-3								
Cyanide, Total	92		96		80-120	4		35

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565714
Report Date: 10/30/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
General Chemistry - Westborough Lab Associated sample(s): 01-10 QC Batch ID: WG2129897-4 QC Sample: L2565714-10 Client ID: P6SB05_5-6												
Chromium, Hexavalent	ND	1430	1360	95		-	-		75-125	-		
General Chemistry - Westborough Lab Associated sample(s): 01-03 QC Batch ID: WG2130920-4 WG2130920-5 QC Sample: L2565754-07 Client ID: MS Sample												
Cyanide, Total	ND	12	8.1	**68**	Q	7.6	**69**	Q	75-125	1		35
General Chemistry - Westborough Lab Associated sample(s): 01-03 QC Batch ID: WG2130920-6 WG2130920-7 QC Sample: L2565754-08 Client ID: MS Sample												
Cyanide, Total	ND	11	8.0	**73**	Q	9.0	75		75-125	4		35
General Chemistry - Westborough Lab Associated sample(s): 04-10 QC Batch ID: WG2131447-4 WG2131447-5 QC Sample: L2565715-03 Client ID: MS Sample												
Cyanide, Total	ND	11	12	110		3.0	**27**	Q	75-125	**120**	Q	35
General Chemistry - Westborough Lab Associated sample(s): 04-10 QC Batch ID: WG2131447-6 WG2131447-7 QC Sample: L2565720-06 Client ID: MS Sample												
Cyanide, Total	ND	9.4	10	110		9.8	100		75-125	10		35

Lab Duplicate Analysis

Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI

Project Number: 170859701

Lab Number: L2565714

Report Date: 10/30/25

Parameter	Native Sample	Duplicate Sample	Units	RPD	Qual	RPD Limits
General Chemistry - Westborough Lab Associated sample(s): 02 QC Batch ID: WG2129552-1 QC Sample: L2565695-02 Client ID: DUP Sample						
Solids, Total	82.9	83.6	%	1		10
General Chemistry - Westborough Lab Associated sample(s): 01,03-10 QC Batch ID: WG2129566-1 QC Sample: L2565591-01 Client ID: DUP Sample						
Solids, Total	96.6	96.8	%	0		10
General Chemistry - Westborough Lab Associated sample(s): 01-10 QC Batch ID: WG2129897-6 QC Sample: L2565714-10 Client ID: P6SB05_5-6						
Chromium, Hexavalent	ND	ND	mg/kg	NC		20

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565714
Report Date: 10/30/25

Sample Receipt and Container Information

Were project specific reporting limits specified? YES

Cooler Information

Cooler	Custody Seal
A	Absent
B	Absent
C	Absent
D	Absent

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565714-01A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565714-01B	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-01C	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-01D	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),BA-TI(180),AS-TI(180),AG-TI(180),NI-TI(180),TL-TI(180),AL-TI(180),CR-TI(180),PB-TI(180),SE-TI(180),SB-TI(180),CU-TI(180),ZN-TI(180),CO-TI(180),V-TI(180),HG-T(28),MG-TI(180),FE-TI(180),MN-TI(180),NA-TI(180),CA-TI(180),K-TI(180),CD-TI(180)
L2565714-01E	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-01F	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565714-01G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-02A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565714-02B	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-02C	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)

*Values in parentheses indicate holding time in days

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565714
Report Date: 10/30/25

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565714-02D	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),BA-TI(180),AS-TI(180),AG-TI(180),TL-TI(180),AL-TI(180),NI-TI(180),CR-TI(180),SB-TI(180),SE-TI(180),ZN-TI(180),CU-TI(180),PB-TI(180),CO-TI(180),V-TI(180),MN-TI(180),HG-T(28),FE-TI(180),MG-TI(180),CD-TI(180),K-TI(180),CA-TI(180),NA-TI(180)
L2565714-02E	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HOLD-8151(14),TS(7),HOLD-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-02G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HOLD-8151(14),TS(7),HOLD-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-03A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565714-03B	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-03C	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-03D	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),AS-TI(180),BA-TI(180),AG-TI(180),AL-TI(180),NI-TI(180),TL-TI(180),CR-TI(180),SB-TI(180),ZN-TI(180),PB-TI(180),CU-TI(180),SE-TI(180),CO-TI(180),V-TI(180),MN-TI(180),HG-T(28),MG-TI(180),FE-TI(180),CA-TI(180),K-TI(180),CD-TI(180),NA-TI(180)
L2565714-03E	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-03F	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565714-03G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-04A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565714-04B	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-04C	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)

*Values in parentheses indicate holding time in days

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565714
Report Date: 10/30/25

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565714-04D	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),AS-TI(180),BA-TI(180),AG-TI(180),TL-TI(180),CR-TI(180),AL-TI(180),NI-TI(180),SE-TI(180),CU-TI(180),ZN-TI(180),PB-TI(180),SB-TI(180),V-TI(180),CO-TI(180),MG-TI(180),FE-TI(180),HG-T(28),MN-TI(180),CA-TI(180),CD-TI(180),NA-TI(180),K-TI(180)
L2565714-04E	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HOLD-8151(14),NYTCL-8082(365),HOLD-8081(14),HEXCR-7196(30)
L2565714-04F	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565714-04G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HOLD-8151(14),NYTCL-8082(365),HOLD-8081(14),HEXCR-7196(30)
L2565714-05A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565714-05B	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-05C	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-05D	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),AS-TI(180),BA-TI(180),AG-TI(180),CR-TI(180),AL-TI(180),NI-TI(180),TL-TI(180),CU-TI(180),SB-TI(180),SE-TI(180),PB-TI(180),ZN-TI(180),V-TI(180),CO-TI(180),MN-TI(180),HG-T(28),FE-TI(180),MG-TI(180),CA-TI(180),CD-TI(180),K-TI(180),NA-TI(180)
L2565714-05E	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-05F	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565714-05G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-06A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565714-06B	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-06C	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)

*Values in parentheses indicate holding time in days

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565714
Report Date: 10/30/25

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565714-06D	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),AS-TI(180),BA-TI(180),AG-TI(180),TL-TI(180),CR-TI(180),AL-TI(180),NI-TI(180),SB-TI(180),SE-TI(180),ZN-TI(180),CU-TI(180),PB-TI(180),CO-TI(180),V-TI(180),MG-TI(180),FE-TI(180),HG-T(28),MN-TI(180),K-TI(180),NA-TI(180),CA-TI(180),CD-TI(180)
L2565714-06E	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HOLD-8151(14),HOLD-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-06F	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565714-06G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HOLD-8151(14),HOLD-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-07A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565714-07B	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-07C	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-07D	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),BA-TI(180),AS-TI(180),AG-TI(180),CR-TI(180),NI-TI(180),TL-TI(180),AL-TI(180),SB-TI(180),PB-TI(180),ZN-TI(180),CU-TI(180),SE-TI(180),V-TI(180),CO-TI(180),FE-TI(180),HG-T(28),MN-TI(180),MG-TI(180),CA-TI(180),K-TI(180),CD-TI(180),NA-TI(180)
L2565714-07E	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-07F	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565714-07G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		NYTCL-8270(14),TCN-9010(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-08A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565714-08B	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-08C	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)

*Values in parentheses indicate holding time in days

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565714
Report Date: 10/30/25

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565714-08D	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),AS-TI(180),BA-TI(180),AG-TI(180),TL-TI(180),NI-TI(180),AL-TI(180),CR-TI(180),SB-TI(180),CU-TI(180),ZN-TI(180),SE-TI(180),PB-TI(180),V-TI(180),CO-TI(180),HG-T(28),MG-TI(180),MN-TI(180),FE-TI(180),CA-TI(180),K-TI(180),NA-TI(180),CD-TI(180)
L2565714-08E	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HOLD-8151(14),HOLD-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-08F	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565714-08G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HOLD-8151(14),HOLD-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-09A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565714-09B	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-09C	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-09D	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),AS-TI(180),BA-TI(180),AG-TI(180),CR-TI(180),AL-TI(180),NI-TI(180),TL-TI(180),CU-TI(180),PB-TI(180),SB-TI(180),SE-TI(180),ZN-TI(180),V-TI(180),CO-TI(180),MN-TI(180),HG-T(28),FE-TI(180),MG-TI(180),NA-TI(180),CA-TI(180),K-TI(180),CD-TI(180)
L2565714-09E	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-09F	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565714-09G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HERB-APA(14),NYTCL-8081(14),NYTCL-8082(365),HEXCR-7196(30)
L2565714-10A	Vial MeOH preserved	NA	NA			Y	Absent		NYTCL-8260HLW(14)
L2565714-10B	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)
L2565714-10C	Vial water preserved	NA	NA			Y	Absent	17-OCT-25 17:22	NYTCL-8260HLW(14)

*Values in parentheses indicate holding time in days

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565714
Report Date: 10/30/25

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565714-10D	Metals Only-Glass 60mL/2oz unpreserved	NA	NA			Y	Absent		BE-TI(180),AS-TI(180),BA-TI(180),AG-TI(180),TL-TI(180),AL-TI(180),CR-TI(180),NI-TI(180),PB-TI(180),SE-TI(180),SB-TI(180),ZN-TI(180),CU-TI(180),CO-TI(180),V-TI(180),MN-TI(180),HG-T(28),FE-TI(180),MG-TI(180),K-TI(180),NA-TI(180),CA-TI(180),CD-TI(180)
L2565714-10E	Glass 120ml/4oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HOLD-8151(14),NYTCL-8082(365),HOLD-8081(14),HEXCR-7196(30)
L2565714-10F	Plastic 120ml unpreserved	NA	NA			Y	Absent		TS(7)
L2565714-10G	Glass 500ml/16oz unpreserved	NA	NA			Y	Absent		TCN-9010(14),NYTCL-8270(14),HOLD-8151(14),NYTCL-8082(365),HOLD-8081(14),HEXCR-7196(30)

*Values in parentheses indicate holding time in days

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565714
Project Number:	170859701	**Report Date:**	10/30/25

GLOSSARY

Acronyms

DL	- Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the limit of quantitation (LOQ). The DL includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)
EDL	- Estimated Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the reporting limit (RL). The EDL includes any adjustments from dilutions, concentrations or moisture content, where applicable. The use of EDLs is specific to the analysis of PAHs using Solid-Phase Microextraction (SPME).
EMPC	- Estimated Maximum Possible Concentration: The concentration that results from the signal present at the retention time of an analyte when the ions meet all of the identification criteria except the ion abundance ratio criteria. An EMPC is a worst-case estimate of the concentration.
EPA	- Environmental Protection Agency.
LCS	- Laboratory Control Sample: A sample matrix, free from the analytes of interest, spiked with verified known amounts of analytes or a material containing known and verified amounts of analytes.
LCSD	- Laboratory Control Sample Duplicate: Refer to LCS.
LFB	- Laboratory Fortified Blank: A sample matrix, free from the analytes of interest, spiked with verified known amounts of analytes or a material containing known and verified amounts of analytes.
LOD	- Limit of Detection: This value represents the level to which a target analyte can reliably be detected for a specific analyte in a specific matrix by a specific method. The LOD includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)
LOQ	- Limit of Quantitation: The value at which an instrument can accurately measure an analyte at a specific concentration. The LOQ includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.) Limit of Quantitation: The value at which an instrument can accurately measure an analyte at a specific concentration. The LOQ includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)
MDL	- Method Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the reporting limit (RL). The MDL includes any adjustments from dilutions, concentrations or moisture content, where applicable.
MS	- Matrix Spike Sample: A sample prepared by adding a known mass of target analyte to a specified amount of matrix sample for which an independent estimate of target analyte concentration is available. For Method 332.0, the spike recovery is calculated using the native concentration, including estimated values.
MSD	- Matrix Spike Sample Duplicate: Refer to MS.
NA	- Not Applicable.
NC	- Not Calculated: Term is utilized when one or more of the results utilized in the calculation are non-detect at the parameter's reporting unit.
NDPA/DPA	- N-Nitrosodiphenylamine/Diphenylamine.
NI	- Not Ignitable.
NP	- Non-Plastic: Term is utilized for the analysis of Atterberg Limits in soil.
NR	- No Results: Term is utilized when 'No Target Compounds Requested' is reported for the analysis of Volatile or Semivolatile Organic TIC only requests.
RL	- Reporting Limit: The value at which an instrument can accurately measure an analyte at a specific concentration. The RL includes any adjustments from dilutions, concentrations or moisture content, where applicable.
RPD	- Relative Percent Difference: The results from matrix and/or matrix spike duplicates are primarily designed to assess the precision of analytical results in a given matrix and are expressed as relative percent difference (RPD). Values which are less than five times the reporting limit for any individual parameter are evaluated by utilizing the absolute difference between the values; although the RPD value will be provided in the report.
SRM	- Standard Reference Material: A reference sample of a known or certified value that is of the same or similar matrix as the associated field samples.
STLP	- Semi-dynamic Tank Leaching Procedure per EPA Method 1315.
TEF	- Toxic Equivalency Factors: The values assigned to each dioxin and furan to evaluate their toxicity relative to 2,3,7,8-TCDD.
TEQ	- Toxic Equivalent: The measure of a sample's toxicity derived by multiplying each dioxin and furan by its corresponding TEF and then summing the resulting values.
TIC	- Tentatively Identified Compound: A compound that has been identified to be present and is not part of the target compound list (TCL) for the method and/or program. All TICs are qualitatively identified and reported as estimated concentrations.

Report Format: DU Report with 'J' Qualifiers

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565714
Project Number:	170859701	**Report Date:**	10/30/25

Footnotes

1 - The reference for this analyte should be considered modified since this analyte is absent from the target analyte list of the original method.

Terms

Analytical Method: Both the document from which the method originates and the analytical reference method. (Example: EPA 8260B is shown as 1,8260B.) The codes for the reference method documents are provided in the References section of the Addendum.

Chlordane: The target compound Chlordane (CAS No. 57-74-9) is reported for GC ECD analyses. Per EPA,this compound "refers to a mixture of chlordane isomers, other chlorinated hydrocarbons and numerous other components." (Reference: USEPA Toxicological Review of Chlordane, In Support of Summary Information on the Integrated Risk Information System (IRIS), December 1997.)

Difference: With respect to Total Oxidizable Precursor (TOP) Assay analysis, the difference is defined as the Post-Treatment value minus the Pre-Treatment value.

Final pH: As it pertains to Sample Receipt & Container Information section of the report, Final pH reflects pH of container determined after adjustment at the laboratory, if applicable. If no adjustment required, value reflects Initial pH.

Frozen Date/Time: With respect to Volatile Organics in soil, Frozen Date/Time reflects the date/time at which associated Reagent Water-preserved vials were initially frozen. Note: If frozen date/time is beyond 48 hours from sample collection, value will be reflected in 'bold'.

Gasoline Range Organics (GRO): Gasoline Range Organics (GRO) results include all chromatographic peaks eluting from Methyl tert butyl ether through Naphthalene, with the exception of GRO analysis in support of State of Ohio programs, which includes all chromatographic peaks eluting from Hexane through Dodecane.

Initial pH: As it pertains to Sample Receipt & Container Information section of the report, Initial pH reflects pH of container determined upon receipt, if applicable.

PAH Total: With respect to Alkylated PAH analyses, the 'PAHs, Total' result is defined as the summation of results for all or a subset of the following compounds: Naphthalene, C1-C4 Naphthalenes, 2-Methylnaphthalene, 1-Methylnaphthalene, Biphenyl, Acenaphthylene, Acenaphthene, Fluorene, C1-C3 Fluorenes, Phenanthrene, C1-C4 Phenanthrenes/Anthracenes, Anthracene, Fluoranthene, Pyrene, C1-C4 Fluoranthenes/Pyrenes, Benz(a)anthracene, Chrysene, C1-C4 Chrysenes, Benzo(b)fluoranthene, Benzo(j)+(k)fluoranthene, Benzo(e)pyrene, Benzo(a)pyrene, Perylene, Indeno(1,2,3-cd)pyrene, Dibenz(ah)+(ac)anthracene, Benzo(g,h,i)perylene. If a 'Total' result is requested, the results of its individual components will also be reported.

PFAS Total: With respect to PFAS analyses, the 'PFAS, Total (5)' result is defined as the summation of results for: PFHpA, PFHxS, PFOA, PFNA and PFOS. In addition, the 'PFAS, Total (6)' result is defined as the summation of results for: PFHpA, PFHxS, PFOA, PFNA, PFDA and PFOS. For MassDEP DW compliance analysis only, the 'PFAS, Total (6)' result is defined as the summation of results at or above the RL. Note: If a 'Total' result is requested, the results of its individual components will also be reported.

Total: With respect to Organic analyses, a 'Total' result is defined as the summation of results for individual isomers or Aroclors. If a 'Total' result is requested, the results of its individual components will also be reported. This is applicable to 'Total' results for methods 8260, 8081 and 8082.

Data Qualifiers

A - Spectra identified as "Aldol Condensates" are byproducts of the extraction/concentration procedures when acetone is introduced in the process.

B - The analyte was detected above the reporting limit in the associated method blank. Flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank. For MCP-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank. For DOD-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank AND the analyte was detected above one-half the reporting limit (or above the reporting limit for common lab contaminants) in the associated method blank. For NJ-Air-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte above the reporting limit. For NJ-related projects (excluding Air), flag only applies to associated field samples that have detectable concentrations of the analyte, which was detected above the reporting limit in the associated method blank or above five times the reporting limit for common lab contaminants (Phthalates, Acetone, Methylene Chloride, 2-Butanone).

C - Co-elution: The target analyte co-elutes with a known lab standard (i.e. surrogate, internal standards, etc.) for co-extracted analyses.

D - Concentration of analyte was quantified from diluted analysis. Flag only applies to field samples that have detectable concentrations of the analyte.

E - Concentration of analyte exceeds the range of the calibration curve and/or linear range of the instrument.

F - The ratio of quantifier ion response to qualifier ion response falls outside of the laboratory criteria. Results are considered to be an estimated maximum concentration.

G - The concentration may be biased high due to matrix interferences (i.e, co-elution) with non-target compound(s). The result should be considered estimated.

H - The analysis of pH was performed beyond the regulatory-required holding time of 15 minutes from the time of sample collection.

I - The lower value for the two columns has been reported due to obvious interference.

J - Estimated value. The Target analyte concentration is below the quantitation limit (RL), but above the Method Detection Limit (MDL) or Estimated Detection Limit (EDL) for SPME-related analyses. This represents an estimated concentration for Tentatively Identified Compounds (TICs). For calculated parameters, this represents that one or more values used in the calculation were

Report Format: DU Report with 'J' Qualifiers

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565714
Project Number:	170859701	**Report Date:**	10/30/25

Data Qualifiers

estimated.

M - Reporting Limit (RL) exceeds the MCP CAM Reporting Limit for this analyte.

ND - Not detected at the method detection limit (MDL) for the sample, or estimated detection limit (EDL) for SPME-related analyses.

NJ - Presumptive evidence of compound. This represents an estimated concentration for Tentatively Identified Compounds (TICs), where the identification is based on a mass spectral library search.

P - The RPD between the results for the two columns exceeds the method-specified criteria.

Q - The quality control sample exceeds the associated acceptance criteria. For DOD-related projects, LCS and/or Continuing Calibration Standard exceedences are also qualified on all associated sample results. Note: This flag is not applicable for matrix spike recoveries when the sample concentration is greater than 4x the spike added or for batch duplicate RPD when the sample concentrations are less than 5x the RL. (Metals only.)

R - Analytical results are from sample re-analysis.

RE - Analytical results are from sample re-extraction.

S - Analytical results are from modified screening analysis.

V - The surrogate associated with this target analyte has a recovery outside the QC acceptance limits. (Applicable to MassDEP DW Compliance samples only.)

Z - The batch matrix spike and/or duplicate associated with this target analyte has a recovery/RPD outside the QC acceptance limits. (Applicable to MassDEP DW Compliance samples only.)

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565714

Project Number: 170859701 **Report Date:** 10/30/25

REFERENCES

1 Test Methods for Evaluating Solid Waste: Physical/Chemical Methods. EPA SW-846. Third Edition. Updates I - VI, 2018.

107 Calculation method.

121 Standard Methods for the Examination of Water and Wastewater. APHA-AWWA-WEF. Standard Methods Online.

LIMITATION OF LIABILITIES

Pace Analytical Services performs services with reasonable care and diligence normal to the analytical testing laboratory industry. In the event of an error, the sole and exclusive responsibility of Pace Analytical Services shall be to re-perform the work at it's own expense. In no event shall Pace Analytical Services be held liable for any incidental, consequential or special damages, including but not limited to, damages in any way connected with the use of, interpretation of, information or analysis provided by Pace Analytical Services.

We strongly urge our clients to comply with EPA protocol regarding sample volume, preservation, cooling, containers, sampling procedures, holding time and splitting of samples in the field.

Certification Information

The following analytes are not included in our Primary NELAP Scope of Accreditation:

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581
EPA 624.1: m/p-xylene, o-xylene, Naphthalene
EPA 625.1: alpha-Terpineol
EPA 8260D: NPW: 1,2,4,5-Tetramethylbenzene; 4-Ethyltoluene; SCM: Iodomethane (methyl iodide), 1,2,4,5-Tetramethylbenzene; 4-Ethyltoluene.
EPA 8270E: NPW: Dimethylnaphthalene,1,4-Diphenylhydrazine, alpha-Terpineol, Azobenzene; SCM: Dimethylnaphthalene,1,4-Diphenylhydrazine.
SM4500: NPW: Amenable Cyanide; SCM: Total Phosphorus, TKN, NO2, NO3.

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
SM 2540D: TSS.
EPA TO-15: Halothane, 2,4,4-Trimethyl-2-pentene, 2,4,4-Trimethyl-1-pentene, Thiophene, 2-Methylthiophene, 3-Methylthiophene, 2-Ethylthiophene, 1,2,3-Trimethylbenzene, Indan, Indene, 1,2,4,5-Tetramethylbenzene, Benzothiophene, 1-Methylnaphthalene.
MADEP-APH.
Nonpotable Water: EPA RSK-175 Dissolved Gases
Biological Tissue Matrix: EPA 3050B

Mansfield Facility – 120 Forbes Blvd. Mansfield, MA 02048
EPA TO-15: Halothane, 2,4,4-Trimethyl-2-pentene, 2,4,4-Trimethyl-1-pentene, Thiophene, 2-Methylthiophene, 3-Methylthiophene, 2-Ethylthiophene, 1,2,3-Trimethylbenzene, Indan, Indene, 1,2,4,5-Tetramethylbenzene, Benzothiophene, 1-Methylnaphthalene.
Nonpotable Water: EPA RSK-175 Dissolved Gases

The following test method is not included in our New Jersey Secondary NELAP Scope of Accreditation:

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
Determination of Selected Perfluorinated Alkyl Substances by Solid Phase Extraction and Liquid Chromatography/Tandem Mass Spectrometry Isotope Dilution (via Alpha SOP 23528)

The following analytes are included in our Massachusetts DEP Scope of Accreditation

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581

Drinking Water
EPA 300.0: Chloride, Nitrate-N, Fluoride, Sulfate; **EPA 353.2**: Nitrate-N, Nitrite-N; **SM4500NO3-F**: Nitrate-N, Nitrite-N; **SM4500F-C, SM4500CN-CE, EPA 180.1, SM2130B, SM4500Cl-D, SM2320B, SM2540C, SM4500H-B, SM4500NO2-B**
EPA 524.2: THMs and VOCs; **EPA 504.1:** EDB, DBCP.
Microbiology: **SM9215B; SM9223-P/A, SM9223B-Colilert-QT,SM9222D**.

Non-Potable Water
SM4500H,B, EPA 120.1, SM2510B, SM2540C, SM2320B, SM4500CL-E, SM4500F-BC, SM4500NH3-BH: Ammonia-N and Kjeldahl-N, **EPA 350.1**: Ammonia-N, **LACHAT 10-107-06-1-B**: Ammonia-N, **EPA 351.1, SM4500NO3-F, EPA 353.2**: Nitrate-N**, SM4500P-E, SM4500P-B, E, SM4500SO4-E, SM5220D, EPA 410.4, SM5210B, SM5310C, SM4500CL-D, SM4500CL-G, EPA 1664, EPA 420.1, SM4500-CN-CE, SM2540D, EPA 300: Chloride, Sulfate, Nitrate.**
EPA 624.1: Volatile Halocarbons & Aromatics,
EPA 608.3: Chlordane, Toxaphene, Aldrin, alpha-BHC, beta-BHC, gamma-BHC, delta-BHC, Dieldrin, DDD, DDE, DDT, Endosulfan I, Endosulfan II, Endosulfan sulfate, Endrin, Endrin Aldehyde, Heptachlor, Heptachlor Epoxide, PCBs
EPA 625.1: SVOC (Acid/Base/Neutral Extractables).
Microbiology: **SM9223B-Colilert-QT; Enterolert-QT.**

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048

Drinking Water
EPA 200.7: Al, Ba, Cd, Cr, Cu, Fe, Mn, Ni, Na, Ag, Ca, Zn. **EPA 200.8:** Al, Sb, As, Ba, Be, Cd, Cr, Cu, Pb, Mn, Ni, Se, Ag, TL, Zn. **EPA 245.1** Hg.
EPA 522, EPA 537.1.

Non-Potable Water
EPA 200.7: Al, Sb, As, Be, Cd, Ca, Cr, Co, Cu, Fe, Pb, Mg, Mn, Mo, Ni, K, Se, Ag, Na, Sr, TL, Ti, V, Zn.
EPA 200.8: Al, Sb**,** As, Be, Cd, Ca, Cr, Cu, Fe, Pb, Mg, Mn, Ni, K, Se, Ag, Na, TL, Zn.
EPA 245.1: Hg. **EPA 245.7:** Hg.
SM2340B

Certification IDs:

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581
CT PH-0826, IL 200077, IN C-MA-03, KY kY98045, ME MA00086, MD 348, MA M-MA086, NH 2064, NJ MA935, NY 11148, NC (DW) 25700, NC (NPW/SCM) 666, OR MA-1316, PA 68-03671, RI LAO00065, TX T104704476, VT VT-0935, VA 460195

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
MA M-MA00030, CT PH-0825, ANAB/DoD L2474, IL 200081, IN C-MA-04, KY KY98046, LA 85084, ME MA00030, MI 9110, MN 025-999-495, NH 2062, NJ MA015, NY 11627, NC (NPW/SCM) 685, OR MA-0262, PA 68-02089, RI LAO00299, TX T-104704419, VT VT-0015, VA 460194, WA C954

Mansfield Facility – 120 Forbes Blvd. Mansfield, MA 02048
ANAB/DoD L2474, LA 245052, ME MA01156, MN 025-999-498, NH 2249, NJ MA025, NY 12191, OR 4203, TX T104704583, VA 460311, WA C1104.

For a complete listing of analytes and methods, please contact your Project Manager.

NEW YORK CHAIN OF CUSTODY

ALPHA

Westborough, MA 01581
8 Walkup Dr.
TEL: 508-898-9220
FAX: 508-898-9193

Mansfield, MA 02048
320 Forbes Blvd
TEL: 508-822-9300
FAX: 508-822-3288

Service Centers
Mahwah, NJ 07430: 35 Whitney Rd, Suite 5
Albany, NY 12205: 14 Walker Way
Tonawanda, NY 14150: 275 Cooper Ave, Suite 105

Page 1 of 1

Date Rec'd in Lab: 10/17/25

ALPHA Job #: L2565714

Client Information

Client: Langan Engineering
Address: 368 9th Ave, 8th Fl
New York, NY 10001
Phone: 212-479-5402
Fax: N/A
Email: lhaley@langan.com

Project Information

Project Name: East Adams Redevelopment
Project Location: Syracuse, NY Phase VI
Project #: 170859701
(Use Project name as Project #) ☐
Project Manager: Lexi Haley
ALPHAQuote #: 26297

Turn-Around Time

Standard ☒ Due Date:
Rush (only if pre approved) ☐ # of Days:

Deliverables

☒ ASP-A ☐ ASP-B
☐ EQuIS (1 File) ☐ EQuIS (4 File)
☐ Other

Regulatory Requirement

☐ NY TOGS ☒ NY Part 375
☐ AWQ Standards ☐ NY CP-51
☐ NY Restricted Use ☐ Other
☐ NY Unrestricted Use
☐ NYC Sewer Discharge

Billing Information

☐ Same as Client Info
PO #

Disposal Site Information

Please identify below location of applicable disposal facilities.
Disposal Facility:
☐ NJ ☐ NY
☐ Other:

These samples have been previously analyzed by Alpha ☐

Other project specific requirements/comments:

Please cc. ksemon@langan.com, pdinardo@langan.com, and datamanagement@langan.com

Please specify Metals or TAL.

ANALYSIS

Sample Filtration
☐ Done
☐ Lab to do
Preservation
☐ Lab to do
(Please Specify below)

ALPHA Lab ID (Lab Use Only)	Sample ID	Collection Date	Collection Time	Sample Matrix	Sampler's Initials	Part 375/TCL VOCs	PCBs, pesticides, herbicides	TAL metals (+ hex/tri chrom)	Total cyanide					Sample Specific Comments	Total Bottle
L2565714-01	P6SB02-1-2	10/16/25	0815	S	AMB	X	X	X	X						7
-02	P6SB02-3-4		0845		AMB	X	X	X	X					pest./herb hold	
-03	P6SB09-1-2		1030		AMB	X	X	X	X						
-04	P6SB09-3-4		1045		AMB	X	X	X	X					hold pest./herb	
-05	P6SB08-0-1		0920		AMB	X	X	X	X						
-06	P6SB08-2-3		0940		AMB	X	X	X	X					hold pest./herb	
-07	P6SB01-0-1		1300		AMB	X	X	X	X						
-08	P6SB01-5-6		1345		JG	X	X	X	X					hold pest./herb	
-09	P6SB05-1-2		1405		JG	X	X	X	X						
-10	P6SB05-5-6		1430		JG	X	X	X	X					hold pest./herb	
	Container Type					V	A	A	A						
	Preservative					F O	A	A	A						

Preservative Code:
A = None
B = HCl
C = HNO_3
D = H_2SO_4
E = NaOH
F = MeOH
G = $NaHSO_4$
H = $Na_2S_2O_3$
K/E = Zn Ac/NaOH
O = Other

Container Code
P = Plastic
A = Amber Glass
V = Vial
G = Glass
B = Bacteria Cup
C = Cube
O = Other
E = Encore
D = BOD Bottle

Westboro: Certification No: MA935
Mansfield: Certification No: MA015

Relinquished By:	Date/Time	Received By:	Date/Time
Jacob Gessin	10/16/25 1615		10/16 1615
	10/16 1700		10/16/25 1700
	10-16-25		10/16 2300
	10/17 0300		10/17/25 0300

Please print clearly, legibly and completely. Samples can not be logged in and turnaround time clock will not start until any ambiguities are resolved. BY EXECUTING THIS COC, THE CLIENT HAS READ AND AGREES TO BE BOUND BY ALPHA'S TERMS & CONDITIONS. (See reverse side.)

Form No: 01-25 HC (rev. 30-Sept-2013)

Sample Delivery Group Summary

Pace Job Number : L2565714
Received : 16-OCT-2025
Reviewer : Harmony Evans

Account Name : Langan Engineering & Environmental
Project Number : 170859701
Project Name : EAST ADAMS REDEVELOPMENT PHVI

Delivery Information

Samples Delivered By : Pace Courier

Chain of Custody : Present

Cooler Information

Cooler	Seal/Seal#	Preservation	Temperature(°C)	Additional Information
A	Absent/	Ice	2.2	
B	Absent/	Ice	4.2	
C	Absent/	Ice	3.9	
D	Absent/	Ice	4.0	

Condition Information

1) All samples on COC received?	**YES**
2) Extra samples received?	**NO**
3) Are there any sample container discrepancies?	**NO**
4) Are there any discrepancies between COC & sample labels? L2565714-06: 16-OCT-25 09:40 vs. 16-OCT-25 09:45	**YES**
5) Are samples in appropriate containers for requested analysis?	**YES**
6) Are samples properly preserved for requested analysis?	**YES**
7) Are samples within holding time for requested analysis?	**YES**
8) All sampling equipment returned?	**NA**

Volatile Organics/VPH

1) Reagent Water Vials Frozen by Client?	**NO**

ANALYTICAL REPORT

Lab Number:	L2565314
Client:	Langan Engineering & Environmental 21 Penn Plaza 360 West 31st Street, 8th Floor New York, NY 10001-2727
ATTN:	Lexi Haley
Phone:	(212) 479-5499
Project Name:	EAST ADAMS REDEVELOPMENT PHVI
Project Number:	170859701
Report Date:	10/29/25

The original project report/data package is held by Pace Analytical Services. This report/data package is paginated and should be reproduced only in its entirety. Pace Analytical Services holds no responsibility for results and/or data that are not consistent with the original.

Certifications & Approvals: MA (M-MA086), NH NELAP (2064), CT (PH-0826), IL (200077), IN (C-MA-03), KY (KY98045), ME (MA00086), MD (348), NJ (MA935), NY (11148), NC (25700/666), OR (MA-1316), PA (68-03671), RI (LAO00065), TX (T104704476), VT (VT-0935), VA (460195), USDA (Permit #525-23-122-91930A1).

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565314
Report Date: 10/29/25

Lab Sample ID	Client ID	Matrix	Sample Location	Collection Date/Time	Receive Date
L2565314-01	P6TMW03_101525	WATER	SYRACUSE NY	10/15/25 14:35	10/15/25

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565314
Project Number:	170859701	**Report Date:**	10/29/25

Case Narrative

The samples were received in accordance with the Chain of Custody and no significant deviations were encountered during the preparation or analysis unless otherwise noted. Sample Receipt, Container Information, and the Chain of Custody are located at the back of the report.

Results contained within this report relate only to the samples submitted under this Pace Lab Number and meet NELAP requirements for all NELAP accredited parameters unless otherwise noted in the following narrative. The data presented in this report is organized by parameter (i.e. VOC, SVOC, etc.). Sample specific Quality Control data (i.e. Surrogate Spike Recovery) is reported at the end of the target analyte list for each individual sample, followed by the Laboratory Batch Quality Control at the end of each parameter. Tentatively Identified Compounds (TICs), if requested, are reported for compounds identified to be present and are not part of the method/program Target Compound List, even if only a subset of the TCL are being reported. If a sample was re-analyzed or re-extracted due to a required quality control corrective action and if both sets of data are reported, the Laboratory ID of the re-analysis or re-extraction is designated with an "R" or "RE", respectively.

When multiple Batch Quality Control elements are reported (e.g. more than one LCS), the associated samples for each element are noted in the grey shaded header line of each data table. Any Laboratory Batch, Sample Specific % recovery or RPD value that is outside the listed Acceptance Criteria is bolded in the report. In reference to questions H (CAM) or 4 (RCP) when "NO" is checked, the performance criteria for CAM and RCP methods allow for some quality control failures to occur and still be within method compliance. In these instances, the specific failure is not narrated but noted in the associated QC Outlier Summary Report, located directly after the Case Narrative. QC information is also incorporated in the Data Usability Assessment table (Format 11) of our Data Merger tool, where it can be reviewed in conjunction with the sample result, associated regulatory criteria and any associated data usability implications.

Soil/sediments and solids are reported on a dry weight basis unless otherwise noted. Tissues are reported "as received" or on a wet weight basis, unless otherwise noted. Definitions of all data qualifiers and acronyms used in this report are provided in the Glossary located at the back of the report.

HOLD POLICY - For samples submitted on hold, Pace's policy is to hold samples (with the exception of Air canisters) free of charge for 21 calendar days from the date the project is completed. After 21 calendar days, we will dispose of all samples submitted including those put on hold unless you have contacted your Pace Project Manager and made arrangements for Pace to continue to hold the samples. Air canisters will be disposed after 3 business days from the date the project is completed.

Please contact Project Management at 800-624-9220 with any questions.

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565314
Project Number:	170859701	**Report Date:**	10/29/25

Case Narrative (continued)

Report Submission

October 29, 2025: This final report includes the results of all requested analyses. Additional requests will be reported separately.

October 23, 2025: This is a preliminary report. Please note that your project has contingency samples on hold. Contact your project manager to request additional analyses within 3 business days of receiving this report. Requests made after this time frame will be reported separately.

All non-detect (ND) or estimated concentrations (J-qualified) have been quantitated to the limit noted in the MDL column.

Sample Receipt

L2565314-01: The collection date and time on the chain of custody was 15-OCT-25 14:15; however, the collection date/time on the container label was 15-OCT-25 14:35. At the client's request, the collection date/time is reported as 15-OCT-25 14:35.

Chromium, Hexavalent

L2565314-01: The sample has an elevated detection limit due to the dilution required by the sample matrix.

I, the undersigned, attest under the pains and penalties of perjury that, to the best of my knowledge and belief and based upon my personal inquiry of those responsible for providing the information contained in this analytical report, such information is accurate and complete. This certificate of analysis is not complete unless this page accompanies any and all pages of this report.

Authorized Signature: Cristin Walker

Title: Technical Director/Representative Date: 10/29/25

ORGANICS

VOLATILES

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

SAMPLE RESULTS

Lab ID: L2565314-01 Date Collected: 10/15/25 14:35
Client ID: P6TMW03_101525 Date Received: 10/15/25
Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:
Matrix: Water
Analytical Method: 1,8260D
Analytical Date: 10/22/25 14:46
Analyst: MCM

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by GC/MS - Westborough Lab						
Methylene chloride	ND		ug/l	2.5	0.70	1
1,1-Dichloroethane	ND		ug/l	2.5	0.70	1
Chloroform	ND		ug/l	2.5	0.70	1
Carbon tetrachloride	ND		ug/l	0.50	0.13	1
1,2-Dichloropropane	ND		ug/l	1.0	0.14	1
Dibromochloromethane	ND		ug/l	0.50	0.15	1
1,1,2-Trichloroethane	ND		ug/l	1.5	0.50	1
Tetrachloroethene	ND		ug/l	0.50	0.18	1
Chlorobenzene	ND		ug/l	2.5	0.70	1
Trichlorofluoromethane	ND		ug/l	2.5	0.70	1
1,2-Dichloroethane	ND		ug/l	0.50	0.13	1
1,1,1-Trichloroethane	ND		ug/l	2.5	0.70	1
Bromodichloromethane	ND		ug/l	0.50	0.19	1
trans-1,3-Dichloropropene	ND		ug/l	0.50	0.16	1
cis-1,3-Dichloropropene	ND		ug/l	0.50	0.14	1
1,3-Dichloropropene, Total	ND		ug/l	0.50	0.14	1
1,1-Dichloropropene	ND		ug/l	2.5	0.70	1
Bromoform	ND		ug/l	2.0	0.65	1
1,1,2,2-Tetrachloroethane	ND		ug/l	0.50	0.17	1
Benzene	ND		ug/l	0.50	0.16	1
Toluene	ND		ug/l	2.5	0.70	1
Ethylbenzene	ND		ug/l	2.5	0.70	1
Chloromethane	ND		ug/l	2.5	0.70	1
Bromomethane	ND		ug/l	2.5	0.70	1
Vinyl chloride	ND		ug/l	1.0	0.07	1
Chloroethane	ND		ug/l	2.5	0.70	1
1,1-Dichloroethene	ND		ug/l	0.50	0.17	1
trans-1,2-Dichloroethene	ND		ug/l	2.5	0.70	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

SAMPLE RESULTS

Lab ID: L2565314-01 Date Collected: 10/15/25 14:35

Client ID: P6TMW03_101525 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by GC/MS - Westborough Lab						
Trichloroethene	ND		ug/l	0.50	0.18	1
1,2-Dichlorobenzene	ND		ug/l	2.5	0.70	1
1,3-Dichlorobenzene	ND		ug/l	2.5	0.70	1
1,4-Dichlorobenzene	ND		ug/l	2.5	0.70	1
Methyl tert butyl ether	ND		ug/l	2.5	0.17	1
p/m-Xylene	ND		ug/l	2.5	0.70	1
o-Xylene	ND		ug/l	2.5	0.70	1
Xylenes, Total	ND		ug/l	2.5	0.70	1
cis-1,2-Dichloroethene	ND		ug/l	2.5	0.70	1
1,2-Dichloroethene, Total	ND		ug/l	2.5	0.70	1
Dibromomethane	ND		ug/l	5.0	1.0	1
1,2,3-Trichloropropane	ND		ug/l	2.5	0.70	1
Acrylonitrile	ND		ug/l	5.0	1.5	1
Styrene	ND		ug/l	2.5	0.70	1
Dichlorodifluoromethane	ND		ug/l	5.0	1.0	1
Acetone	2.1	J	ug/l	5.0	1.5	1
Carbon disulfide	ND		ug/l	5.0	1.0	1
2-Butanone	ND		ug/l	5.0	1.9	1
Vinyl acetate	ND		ug/l	5.0	1.0	1
4-Methyl-2-pentanone	ND		ug/l	5.0	1.0	1
2-Hexanone	ND		ug/l	5.0	1.0	1
Bromochloromethane	ND		ug/l	2.5	0.70	1
2,2-Dichloropropane	ND		ug/l	2.5	0.70	1
1,2-Dibromoethane	ND		ug/l	2.0	0.65	1
1,3-Dichloropropane	ND		ug/l	2.5	0.70	1
1,1,1,2-Tetrachloroethane	ND		ug/l	2.5	0.70	1
Bromobenzene	ND		ug/l	2.5	0.70	1
n-Butylbenzene	ND		ug/l	2.5	0.70	1
sec-Butylbenzene	ND		ug/l	2.5	0.70	1
tert-Butylbenzene	ND		ug/l	2.5	0.70	1
o-Chlorotoluene	ND		ug/l	2.5	0.70	1
p-Chlorotoluene	ND		ug/l	2.5	0.70	1
1,2-Dibromo-3-chloropropane	ND		ug/l	2.5	0.70	1
Hexachlorobutadiene	ND		ug/l	2.5	0.70	1
Isopropylbenzene	ND		ug/l	2.5	0.70	1
p-Isopropyltoluene	ND		ug/l	2.5	0.70	1
Naphthalene	ND		ug/l	2.5	0.70	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

SAMPLE RESULTS

Lab ID: L2565314-01 Date Collected: 10/15/25 14:35

Client ID: P6TMW03_101525 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by GC/MS - Westborough Lab						
n-Propylbenzene	ND		ug/l	2.5	0.70	1
1,2,3-Trichlorobenzene	ND		ug/l	2.5	0.70	1
1,2,4-Trichlorobenzene	ND		ug/l	2.5	0.70	1
1,3,5-Trimethylbenzene	ND		ug/l	2.5	0.70	1
1,2,4-Trimethylbenzene	ND		ug/l	2.5	0.70	1
1,4-Dioxane	ND		ug/l	250	61.	1
p-Diethylbenzene	ND		ug/l	2.0	0.70	1
p-Ethyltoluene	ND		ug/l	2.0	0.70	1
1,2,4,5-Tetramethylbenzene	ND		ug/l	2.0	0.54	1
Ethyl ether	ND		ug/l	2.5	0.70	1
trans-1,4-Dichloro-2-butene	ND		ug/l	2.5	0.70	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	107		70-130
Toluene-d8	96		70-130
4-Bromofluorobenzene	98		70-130
Dibromofluoromethane	115		70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/22/25 06:24
Analyst: MCM

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by GC/MS - Westborough Lab for sample(s): 01 Batch: WG2131616-5					
Methylene chloride	ND		ug/l	2.5	0.70
1,1-Dichloroethane	ND		ug/l	2.5	0.70
Chloroform	ND		ug/l	2.5	0.70
Carbon tetrachloride	ND		ug/l	0.50	0.13
1,2-Dichloropropane	ND		ug/l	1.0	0.14
Dibromochloromethane	ND		ug/l	0.50	0.15
1,1,2-Trichloroethane	ND		ug/l	1.5	0.50
Tetrachloroethene	ND		ug/l	0.50	0.18
Chlorobenzene	ND		ug/l	2.5	0.70
Trichlorofluoromethane	ND		ug/l	2.5	0.70
1,2-Dichloroethane	ND		ug/l	0.50	0.13
1,1,1-Trichloroethane	ND		ug/l	2.5	0.70
Bromodichloromethane	ND		ug/l	0.50	0.19
trans-1,3-Dichloropropene	ND		ug/l	0.50	0.16
cis-1,3-Dichloropropene	ND		ug/l	0.50	0.14
1,3-Dichloropropene, Total	ND		ug/l	0.50	0.14
1,1-Dichloropropene	ND		ug/l	2.5	0.70
Bromoform	ND		ug/l	2.0	0.65
1,1,2,2-Tetrachloroethane	ND		ug/l	0.50	0.17
Benzene	ND		ug/l	0.50	0.16
Toluene	ND		ug/l	2.5	0.70
Ethylbenzene	ND		ug/l	2.5	0.70
Chloromethane	ND		ug/l	2.5	0.70
Bromomethane	ND		ug/l	2.5	0.70

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/22/25 06:24
Analyst: MCM

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by GC/MS - Westborough Lab for sample(s): 01 Batch: WG2131616-5					
Vinyl chloride	ND		ug/l	1.0	0.07
Chloroethane	ND		ug/l	2.5	0.70
1,1-Dichloroethene	ND		ug/l	0.50	0.17
trans-1,2-Dichloroethene	ND		ug/l	2.5	0.70
Trichloroethene	ND		ug/l	0.50	0.18
1,2-Dichlorobenzene	ND		ug/l	2.5	0.70
1,3-Dichlorobenzene	ND		ug/l	2.5	0.70
1,4-Dichlorobenzene	ND		ug/l	2.5	0.70
Methyl tert butyl ether	ND		ug/l	2.5	0.17
p/m-Xylene	ND		ug/l	2.5	0.70
o-Xylene	ND		ug/l	2.5	0.70
Xylenes, Total	ND		ug/l	2.5	0.70
cis-1,2-Dichloroethene	ND		ug/l	2.5	0.70
1,2-Dichloroethene, Total	ND		ug/l	2.5	0.70
Dibromomethane	ND		ug/l	5.0	1.0
1,2,3-Trichloropropane	ND		ug/l	2.5	0.70
Acrylonitrile	ND		ug/l	5.0	1.5
Styrene	ND		ug/l	2.5	0.70
Dichlorodifluoromethane	ND		ug/l	5.0	1.0
Acetone	ND		ug/l	5.0	1.5
Carbon disulfide	ND		ug/l	5.0	1.0
2-Butanone	ND		ug/l	5.0	1.9
Vinyl acetate	ND		ug/l	5.0	1.0
4-Methyl-2-pentanone	ND		ug/l	5.0	1.0

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/22/25 06:24
Analyst: MCM

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by GC/MS - Westborough Lab for sample(s): 01 Batch: WG2131616-5					
2-Hexanone	ND		ug/l	5.0	1.0
Bromochloromethane	ND		ug/l	2.5	0.70
2,2-Dichloropropane	ND		ug/l	2.5	0.70
1,2-Dibromoethane	ND		ug/l	2.0	0.65
1,3-Dichloropropane	ND		ug/l	2.5	0.70
1,1,1,2-Tetrachloroethane	ND		ug/l	2.5	0.70
Bromobenzene	ND		ug/l	2.5	0.70
n-Butylbenzene	ND		ug/l	2.5	0.70
sec-Butylbenzene	ND		ug/l	2.5	0.70
tert-Butylbenzene	ND		ug/l	2.5	0.70
o-Chlorotoluene	ND		ug/l	2.5	0.70
p-Chlorotoluene	ND		ug/l	2.5	0.70
1,2-Dibromo-3-chloropropane	ND		ug/l	2.5	0.70
Hexachlorobutadiene	ND		ug/l	2.5	0.70
Isopropylbenzene	ND		ug/l	2.5	0.70
p-Isopropyltoluene	ND		ug/l	2.5	0.70
Naphthalene	ND		ug/l	2.5	0.70
n-Propylbenzene	ND		ug/l	2.5	0.70
1,2,3-Trichlorobenzene	ND		ug/l	2.5	0.70
1,2,4-Trichlorobenzene	ND		ug/l	2.5	0.70
1,3,5-Trimethylbenzene	ND		ug/l	2.5	0.70
1,2,4-Trimethylbenzene	ND		ug/l	2.5	0.70
1,4-Dioxane	ND		ug/l	250	61.
p-Diethylbenzene	ND		ug/l	2.0	0.70

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/22/25 06:24
Analyst: MCM

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by GC/MS - Westborough Lab for sample(s): 01 Batch: WG2131616-5					
p-Ethyltoluene	ND		ug/l	2.0	0.70
1,2,4,5-Tetramethylbenzene	ND		ug/l	2.0	0.54
Ethyl ether	ND		ug/l	2.5	0.70
trans-1,4-Dichloro-2-butene	ND		ug/l	2.5	0.70

Surrogate	%Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	104		70-130
Toluene-d8	96		70-130
4-Bromofluorobenzene	96		70-130
Dibromofluoromethane	114		70-130

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2131616-3 WG2131616-4								
Methylene chloride	92		88		70-130	4		20
1,1-Dichloroethane	98		95		70-130	3		20
Chloroform	88		86		70-130	2		20
Carbon tetrachloride	100		98		63-132	2		20
1,2-Dichloropropane	91		90		70-130	1		20
Dibromochloromethane	86		92		63-130	7		20
1,1,2-Trichloroethane	75		77		70-130	3		20
Tetrachloroethene	99		97		70-130	2		20
Chlorobenzene	91		89		75-130	2		20
Trichlorofluoromethane	97		88		62-150	10		20
1,2-Dichloroethane	94		93		70-130	1		20
1,1,1-Trichloroethane	97		95		67-130	2		20
Bromodichloromethane	90		90		67-130	0		20
trans-1,3-Dichloropropene	82		83		70-130	1		20
cis-1,3-Dichloropropene	92		89		70-130	3		20
1,1-Dichloropropene	90		86		70-130	5		20
Bromoform	83		80		54-136	4		20
1,1,2,2-Tetrachloroethane	79		76		67-130	4		20
Benzene	92		90		70-130	2		20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2131616-3 WG2131616-4								
Toluene	87		84		70-130	4		20
Ethylbenzene	88		85		70-130	3		20
Chloromethane	120		110		64-130	9		20
Bromomethane	57		54		39-139	5		20
Vinyl chloride	72		69		55-140	4		20
Chloroethane	58		56		55-138	4		20
1,1-Dichloroethene	93		92		61-145	1		20
trans-1,2-Dichloroethene	95		90		70-130	5		20
Trichloroethene	92		89		70-130	3		20
1,2-Dichlorobenzene	92		89		70-130	3		20
1,3-Dichlorobenzene	91		88		70-130	3		20
1,4-Dichlorobenzene	90		85		70-130	6		20
Methyl tert butyl ether	78		79		63-130	1		20
p/m-Xylene	90		90		70-130	0		20
o-Xylene	90		90		70-130	0		20
cis-1,2-Dichloroethene	96		93		70-130	3		20
Dibromomethane	89		86		70-130	3		20
1,2,3-Trichloropropane	77		74		64-130	4		20
Acrylonitrile	100		100		70-130	0		20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2131616-3 WG2131616-4								
Styrene	85		85		70-130	0		20
Dichlorodifluoromethane	94		89		36-147	5		20
Acetone	100		97		58-148	3		20
Carbon disulfide	96		92		51-130	4		20
2-Butanone	91		100		63-138	9		20
Vinyl acetate	100		100		70-130	0		20
4-Methyl-2-pentanone	80		76		59-130	5		20
2-Hexanone	93		91		57-130	2		20
Bromochloromethane	98		97		70-130	1		20
2,2-Dichloropropane	95		93		63-133	2		20
1,2-Dibromoethane	84		83		70-130	1		20
1,3-Dichloropropane	80		80		70-130	0		20
1,1,1,2-Tetrachloroethane	91		90		64-130	1		20
Bromobenzene	93		88		70-130	6		20
n-Butylbenzene	86		82		53-136	5		20
sec-Butylbenzene	87		82		70-130	6		20
tert-Butylbenzene	89		85		70-130	5		20
o-Chlorotoluene	84		81		70-130	4		20
p-Chlorotoluene	86		80		70-130	7		20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2131616-3 WG2131616-4								
1,2-Dibromo-3-chloropropane	85		86		41-144	1		20
Hexachlorobutadiene	110		100		63-130	10		20
Isopropylbenzene	88		83		70-130	6		20
p-Isopropyltoluene	90		85		70-130	6		20
Naphthalene	80		77		70-130	4		20
n-Propylbenzene	84		80		69-130	5		20
1,2,3-Trichlorobenzene	93		92		70-130	1		20
1,2,4-Trichlorobenzene	93		90		70-130	3		20
1,3,5-Trimethylbenzene	86		81		64-130	6		20
1,2,4-Trimethylbenzene	87		84		70-130	4		20
1,4-Dioxane	80		80		56-162	0		20
p-Diethylbenzene	89		84		70-130	6		20
p-Ethyltoluene	87		84		70-130	4		20
1,2,4,5-Tetramethylbenzene	82		79		70-130	4		20
Ethyl ether	80		80		59-134	0		20
trans-1,4-Dichloro-2-butene	91		84		70-130	8		20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits

Volatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2131616-3 WG2131616-4

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria
1,2-Dichloroethane-d4	97		97		70-130
Toluene-d8	95		97		70-130
4-Bromofluorobenzene	95		94		70-130
Dibromofluoromethane	100		101		70-130

SEMIVOLATILES

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

SAMPLE RESULTS

Lab ID: L2565314-01
Client ID: P6TMW03_101525
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 14:35
Date Received: 10/15/25
Field Prep: Refer to COC

Sample Depth:
Matrix: Water
Analytical Method: 1,8270E
Analytical Date: 10/17/25 05:57
Analyst: MRG

Extraction Method: EPA 3510C
Extraction Date: 10/16/25 13:05

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
1,2,4-Trichlorobenzene	ND		ug/l	5.0	0.98	1
Bis(2-chloroethyl)ether	ND		ug/l	2.0	0.39	1
1,2-Dichlorobenzene	ND		ug/l	2.0	0.33	1
1,3-Dichlorobenzene	ND		ug/l	2.0	0.32	1
1,4-Dichlorobenzene	ND		ug/l	2.0	0.39	1
3,3'-Dichlorobenzidine	ND		ug/l	5.0	1.8	1
2,4-Dinitrotoluene	ND		ug/l	5.0	0.54	1
2,6-Dinitrotoluene	ND		ug/l	5.0	0.84	1
4-Chlorophenyl phenyl ether	ND		ug/l	2.0	0.39	1
4-Bromophenyl phenyl ether	ND		ug/l	2.0	0.24	1
Bis(2-chloroisopropyl)ether	ND		ug/l	2.0	0.40	1
Bis(2-chloroethoxy)methane	ND		ug/l	5.0	0.84	1
Hexachlorocyclopentadiene	ND		ug/l	20	1.2	1
Isophorone	ND		ug/l	5.0	0.86	1
Nitrobenzene	ND		ug/l	2.0	0.20	1
NDPA/DPA	ND		ug/l	2.0	0.92	1
n-Nitrosodi-n-propylamine	ND		ug/l	5.0	0.91	1
Bis(2-ethylhexyl)phthalate	ND		ug/l	3.0	1.4	1
Butyl benzyl phthalate	ND		ug/l	5.0	2.6	1
Di-n-butylphthalate	ND		ug/l	5.0	0.96	1
Di-n-octylphthalate	ND		ug/l	5.0	2.3	1
Diethyl phthalate	ND		ug/l	5.0	0.76	1
Dimethyl phthalate	ND		ug/l	5.0	0.92	1
Biphenyl	ND		ug/l	2.0	0.20	1
4-Chloroaniline	ND		ug/l	5.0	0.47	1
2-Nitroaniline	ND		ug/l	5.0	1.0	1
3-Nitroaniline	ND		ug/l	5.0	1.2	1
4-Nitroaniline	ND		ug/l	5.0	1.4	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

SAMPLE RESULTS

Lab ID: L2565314-01 Date Collected: 10/15/25 14:35

Client ID: P6TMW03_101525 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Dibenzofuran	ND		ug/l	2.0	0.40	1
1,2,4,5-Tetrachlorobenzene	ND		ug/l	10	0.24	1
Acetophenone	ND		ug/l	5.0	0.92	1
2,4,6-Trichlorophenol	ND		ug/l	5.0	2.1	1
p-Chloro-m-cresol	ND		ug/l	2.0	0.61	1
2-Chlorophenol	ND		ug/l	2.0	0.65	1
2,4-Dichlorophenol	ND		ug/l	5.0	1.7	1
2,4-Dimethylphenol	ND		ug/l	5.0	2.0	1
2-Nitrophenol	ND		ug/l	10	2.0	1
4-Nitrophenol	ND		ug/l	10	1.4	1
2,4-Dinitrophenol	ND		ug/l	20	5.4	1
4,6-Dinitro-o-cresol	ND		ug/l	10	2.3	1
Phenol	ND		ug/l	5.0	0.35	1
2-Methylphenol	ND		ug/l	5.0	2.3	1
3-Methylphenol/4-Methylphenol	ND		ug/l	5.0	1.4	1
2,4,5-Trichlorophenol	ND		ug/l	5.0	2.1	1
Benzoic Acid	8.1	J	ug/l	50	2.6	1
Benzyl Alcohol	ND		ug/l	2.0	0.38	1
Carbazole	ND		ug/l	2.0	0.31	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	35		21-120
Phenol-d6	28		10-120
Nitrobenzene-d5	76		23-120
2-Fluorobiphenyl	57		15-120
2,4,6-Tribromophenol	52		10-120
4-Terphenyl-d14	65		41-149

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

SAMPLE RESULTS

Lab ID: L2565314-01
Client ID: P6TMW03_101525
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 14:35
Date Received: 10/15/25
Field Prep: Refer to COC

Sample Depth:
Matrix: Water
Analytical Method: 1,8270E-SIM
Analytical Date: 10/17/25 19:38
Analyst: CSN

Extraction Method: EPA 3510C
Extraction Date: 10/16/25 13:05

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS-SIM - Westborough Lab						
Acenaphthene	ND		ug/l	0.10	0.02	1
2-Chloronaphthalene	ND		ug/l	0.20	0.02	1
Fluoranthene	ND		ug/l	0.10	0.03	1
Hexachlorobutadiene	ND		ug/l	0.50	0.02	1
Naphthalene	ND		ug/l	0.10	0.02	1
Benzo(a)anthracene	0.04	J	ug/l	0.10	0.03	1
Benzo(a)pyrene	ND		ug/l	0.10	0.02	1
Benzo(b)fluoranthene	ND		ug/l	0.10	0.03	1
Benzo(k)fluoranthene	ND		ug/l	0.10	0.03	1
Chrysene	ND		ug/l	0.10	0.03	1
Acenaphthylene	ND		ug/l	0.10	0.02	1
Anthracene	ND		ug/l	0.10	0.02	1
Benzo(ghi)perylene	ND		ug/l	0.10	0.02	1
Fluorene	ND		ug/l	0.10	0.03	1
Phenanthrene	ND		ug/l	0.10	0.04	1
Dibenzo(a,h)anthracene	ND		ug/l	0.10	0.02	1
Indeno(1,2,3-cd)pyrene	ND		ug/l	0.10	0.02	1
Pyrene	ND		ug/l	0.10	0.04	1
2-Methylnaphthalene	ND		ug/l	0.10	0.03	1
Pentachlorophenol	ND		ug/l	0.80	0.06	1
Hexachlorobenzene	ND		ug/l	0.80	0.01	1
Hexachloroethane	ND		ug/l	0.80	0.02	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

SAMPLE RESULTS

Lab ID: L2565314-01 Date Collected: 10/15/25 14:35

Client ID: P6TMW03_101525 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor

Semivolatile Organics by GC/MS-SIM - Westborough Lab

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	**19**	Q	21-120
Phenol-d6	24		10-120
Nitrobenzene-d5	72		23-120
2-Fluorobiphenyl	71		15-120
2,4,6-Tribromophenol	85		10-120
4-Terphenyl-d14	60		41-149

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/16/25 22:45
Analyst: JG

Extraction Method: EPA 3510C
Extraction Date: 10/16/25 10:46

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01 Batch: WG2128537-1					
Acenaphthene	ND		ug/l	2.0	0.40
1,2,4-Trichlorobenzene	ND		ug/l	5.0	0.98
Hexachlorobenzene	ND		ug/l	2.0	0.45
Bis(2-chloroethyl)ether	ND		ug/l	2.0	0.39
2-Chloronaphthalene	ND		ug/l	2.0	0.35
1,2-Dichlorobenzene	ND		ug/l	2.0	0.33
1,3-Dichlorobenzene	ND		ug/l	2.0	0.32
1,4-Dichlorobenzene	ND		ug/l	2.0	0.39
3,3'-Dichlorobenzidine	ND		ug/l	5.0	1.8
2,4-Dinitrotoluene	ND		ug/l	5.0	0.54
2,6-Dinitrotoluene	ND		ug/l	5.0	0.84
Fluoranthene	ND		ug/l	2.0	0.41
4-Chlorophenyl phenyl ether	ND		ug/l	2.0	0.39
4-Bromophenyl phenyl ether	ND		ug/l	2.0	0.24
Bis(2-chloroisopropyl)ether	ND		ug/l	2.0	0.40
Bis(2-chloroethoxy)methane	ND		ug/l	5.0	0.84
Hexachlorobutadiene	ND		ug/l	2.0	0.36
Hexachlorocyclopentadiene	ND		ug/l	20	1.2
Hexachloroethane	ND		ug/l	2.0	0.20
Isophorone	ND		ug/l	5.0	0.86
Naphthalene	ND		ug/l	2.0	0.54
Nitrobenzene	ND		ug/l	2.0	0.20
NDPA/DPA	ND		ug/l	2.0	0.92
n-Nitrosodi-n-propylamine	ND		ug/l	5.0	0.91

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/16/25 22:45
Analyst: JG

Extraction Method: EPA 3510C
Extraction Date: 10/16/25 10:46

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01 Batch: WG2128537-1					
Bis(2-ethylhexyl)phthalate	ND		ug/l	3.0	1.4
Butyl benzyl phthalate	ND		ug/l	5.0	2.6
Di-n-butylphthalate	ND		ug/l	5.0	0.96
Di-n-octylphthalate	ND		ug/l	5.0	2.3
Diethyl phthalate	ND		ug/l	5.0	0.76
Dimethyl phthalate	ND		ug/l	5.0	0.92
Benzo(a)anthracene	ND		ug/l	2.0	0.32
Benzo(a)pyrene	ND		ug/l	2.0	0.37
Benzo(b)fluoranthene	ND		ug/l	2.0	0.53
Benzo(k)fluoranthene	ND		ug/l	2.0	0.62
Chrysene	ND		ug/l	2.0	0.22
Acenaphthylene	ND		ug/l	2.0	0.32
Anthracene	ND		ug/l	2.0	0.47
Benzo(ghi)perylene	ND		ug/l	2.0	0.37
Fluorene	ND		ug/l	2.0	0.44
Phenanthrene	ND		ug/l	2.0	0.42
Dibenzo(a,h)anthracene	ND		ug/l	2.0	0.29
Indeno(1,2,3-cd)pyrene	ND		ug/l	2.0	0.48
Pyrene	ND		ug/l	2.0	0.41
Biphenyl	ND		ug/l	2.0	0.20
4-Chloroaniline	ND		ug/l	5.0	0.47
2-Nitroaniline	ND		ug/l	5.0	1.0
3-Nitroaniline	ND		ug/l	5.0	1.2
4-Nitroaniline	ND		ug/l	5.0	1.4

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/16/25 22:45
Analyst: JG

Extraction Method: EPA 3510C
Extraction Date: 10/16/25 10:46

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01 Batch: WG2128537-1					
Dibenzofuran	ND		ug/l	2.0	0.40
2-Methylnaphthalene	ND		ug/l	2.0	0.37
1,2,4,5-Tetrachlorobenzene	ND		ug/l	10	0.24
Acetophenone	ND		ug/l	5.0	0.92
2,4,6-Trichlorophenol	ND		ug/l	5.0	2.1
p-Chloro-m-cresol	ND		ug/l	2.0	0.61
2-Chlorophenol	ND		ug/l	2.0	0.65
2,4-Dichlorophenol	ND		ug/l	5.0	1.7
2,4-Dimethylphenol	ND		ug/l	5.0	2.0
2-Nitrophenol	ND		ug/l	10	2.0
4-Nitrophenol	ND		ug/l	10	1.4
2,4-Dinitrophenol	ND		ug/l	20	5.4
4,6-Dinitro-o-cresol	ND		ug/l	10	2.3
Pentachlorophenol	ND		ug/l	10	2.5
Phenol	ND		ug/l	5.0	0.35
2-Methylphenol	ND		ug/l	5.0	2.3
3-Methylphenol/4-Methylphenol	ND		ug/l	5.0	1.4
2,4,5-Trichlorophenol	ND		ug/l	5.0	2.1
Benzoic Acid	ND		ug/l	50	2.6
Benzyl Alcohol	ND		ug/l	2.0	0.38
Carbazole	ND		ug/l	2.0	0.31

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/16/25 22:45
Analyst: JG

Extraction Method: EPA 3510C
Extraction Date: 10/16/25 10:46

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01 Batch: WG2128537-1					

Surrogate	%Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	40		21-120
Phenol-d6	31		10-120
Nitrobenzene-d5	68		23-120
2-Fluorobiphenyl	49		15-120
2,4,6-Tribromophenol	47		10-120
4-Terphenyl-d14	59		41-149

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E-SIM
Analytical Date: 10/17/25 16:06
Analyst: CSN

Extraction Method: EPA 3510C
Extraction Date: 10/16/25 10:46

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS-SIM - Westborough Lab for sample(s): 01 Batch: WG2128538-1					
Acenaphthene	0.04	J	ug/l	0.10	0.02
2-Chloronaphthalene	ND		ug/l	0.20	0.02
Fluoranthene	0.03	J	ug/l	0.10	0.03
Hexachlorobutadiene	ND		ug/l	0.50	0.02
Naphthalene	ND		ug/l	0.10	0.02
Benzo(a)anthracene	0.04	J	ug/l	0.10	0.03
Benzo(a)pyrene	ND		ug/l	0.10	0.02
Benzo(b)fluoranthene	ND		ug/l	0.10	0.03
Benzo(k)fluoranthene	ND		ug/l	0.10	0.03
Chrysene	ND		ug/l	0.10	0.03
Acenaphthylene	ND		ug/l	0.10	0.02
Anthracene	ND		ug/l	0.10	0.02
Benzo(ghi)perylene	ND		ug/l	0.10	0.02
Fluorene	0.03	J	ug/l	0.10	0.03
Phenanthrene	0.06	J	ug/l	0.10	0.04
Dibenzo(a,h)anthracene	ND		ug/l	0.10	0.02
Indeno(1,2,3-cd)pyrene	ND		ug/l	0.10	0.02
Pyrene	ND		ug/l	0.10	0.04
2-Methylnaphthalene	ND		ug/l	0.10	0.03
Pentachlorophenol	ND		ug/l	0.80	0.06
Hexachlorobenzene	ND		ug/l	0.80	0.01
Hexachloroethane	ND		ug/l	0.80	0.02

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E-SIM
Analytical Date: 10/17/25 16:06
Analyst: CSN

Extraction Method: EPA 3510C
Extraction Date: 10/16/25 10:46

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS-SIM - Westborough Lab for sample(s): 01 Batch: WG2128538-1					

Surrogate	%Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	23		21-120
Phenol-d6	26		10-120
Nitrobenzene-d5	74		23-120
2-Fluorobiphenyl	58		15-120
2,4,6-Tribromophenol	91		10-120
4-Terphenyl-d14	57		41-149

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2128537-2 WG2128537-3								
Acenaphthene	62		65		37-111	5		30
1,2,4-Trichlorobenzene	52		51		39-98	2		30
Hexachlorobenzene	73		78		40-140	7		30
Bis(2-chloroethyl)ether	70		68		40-140	3		30
2-Chloronaphthalene	60		60		40-140	0		30
1,2-Dichlorobenzene	46		47		40-140	2		30
1,3-Dichlorobenzene	46		45		40-140	2		30
1,4-Dichlorobenzene	47		46		36-97	2		30
3,3'-Dichlorobenzidine	43		**39**	Q	40-140	10		30
2,4-Dinitrotoluene	74		79		48-143	7		30
2,6-Dinitrotoluene	68		76		40-140	11		30
Fluoranthene	65		65		40-140	0		30
4-Chlorophenyl phenyl ether	68		74		40-140	8		30
4-Bromophenyl phenyl ether	69		72		40-140	4		30
Bis(2-chloroisopropyl)ether	60		59		40-140	2		30
Bis(2-chloroethoxy)methane	74		70		40-140	6		30
Hexachlorobutadiene	55		58		40-140	5		30
Hexachlorocyclopentadiene	44		50		40-140	13		30
Hexachloroethane	50		50		40-140	0		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2128537-2 WG2128537-3								
Isophorone	76		77		40-140	1		30
Naphthalene	57		56		40-140	2		30
Nitrobenzene	77		75		40-140	3		30
NDPA/DPA	69		68		40-140	1		30
n-Nitrosodi-n-propylamine	84		87		29-132	4		30
Bis(2-ethylhexyl)phthalate	88		81		40-140	8		30
Butyl benzyl phthalate	80		79		40-140	1		30
Di-n-butylphthalate	76		73		40-140	4		30
Di-n-octylphthalate	86		78		40-140	10		30
Diethyl phthalate	74		76		40-140	3		30
Dimethyl phthalate	70		73		40-140	4		30
Benzo(a)anthracene	70		69		40-140	1		30
Benzo(a)pyrene	71		69		40-140	3		30
Benzo(b)fluoranthene	70		69		40-140	1		30
Benzo(k)fluoranthene	69		62		40-140	11		30
Chrysene	65		65		40-140	0		30
Acenaphthylene	64		65		45-123	2		30
Anthracene	65		68		40-140	5		30
Benzo(ghi)perylene	58		61		40-140	5		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2128537-2 WG2128537-3								
Fluorene	65		67		40-140	3		30
Phenanthrene	63		63		40-140	0		30
Dibenzo(a,h)anthracene	60		59		40-140	2		30
Indeno(1,2,3-cd)pyrene	60		60		40-140	0		30
Pyrene	65		66		26-127	2		30
Biphenyl	59		59		40-140	0		30
4-Chloroaniline	45		46		40-140	2		30
2-Nitroaniline	76		82		52-143	8		30
3-Nitroaniline	58		62		25-145	7		30
4-Nitroaniline	65		68		51-143	5		30
Dibenzofuran	65		66		40-140	2		30
2-Methylnaphthalene	56		57		40-140	2		30
1,2,4,5-Tetrachlorobenzene	56		58		2-134	4		30
Acetophenone	70		68		39-129	3		30
2,4,6-Trichlorophenol	78		82		30-130	5		30
p-Chloro-m-cresol	78		78		23-97	0		30
2-Chlorophenol	61		62		27-123	2		30
2,4-Dichlorophenol	68		66		30-130	3		30
2,4-Dimethylphenol	52		51		30-130	2		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2128537-2 WG2128537-3								
2-Nitrophenol	66		63		30-130	5		30
4-Nitrophenol	64		69		10-80	8		30
2,4-Dinitrophenol	60		70		20-130	15		30
4,6-Dinitro-o-cresol	70		73		20-164	4		30
Pentachlorophenol	69		76		9-103	10		30
Phenol	38		39		12-110	3		30
2-Methylphenol	64		61		30-130	5		30
3-Methylphenol/4-Methylphenol	62		61		30-130	2		30
2,4,5-Trichlorophenol	82		84		30-130	2		30
Benzoic Acid	53		62		10-164	16		30
Benzyl Alcohol	76		76		26-116	0		30
Carbazole	66		67		55-144	2		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits

Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2128537-2 WG2128537-3

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria
2-Fluorophenol	52		46		21-120
Phenol-d6	38		36		10-120
Nitrobenzene-d5	78		76		23-120
2-Fluorobiphenyl	57		56		15-120
2,4,6-Tribromophenol	76		76		10-120
4-Terphenyl-d14	66		67		41-149

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS-SIM - Westborough Lab	Associated sample(s): 01		Batch: WG2128538-2 WG2128538-3					
Acenaphthene	69		74		40-140	7		40
2-Chloronaphthalene	75		78		40-140	4		40
Fluoranthene	74		77		40-140	4		40
Hexachlorobutadiene	50		54		40-140	8		40
Naphthalene	55		57		40-140	4		40
Benzo(a)anthracene	78		80		40-140	3		40
Benzo(a)pyrene	84		86		40-140	2		40
Benzo(b)fluoranthene	80		84		40-140	5		40
Benzo(k)fluoranthene	84		85		40-140	1		40
Chrysene	77		79		40-140	3		40
Acenaphthylene	84		86		40-140	2		40
Anthracene	80		84		40-140	5		40
Benzo(ghi)perylene	80		82		40-140	2		40
Fluorene	75		79		40-140	5		40
Phenanthrene	66		70		40-140	6		40
Dibenzo(a,h)anthracene	84		87		40-140	4		40
Indeno(1,2,3-cd)pyrene	88		90		40-140	2		40
Pyrene	73		76		40-140	4		40
2-Methylnaphthalene	65		68		40-140	5		40

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS-SIM - Westborough Lab Associated sample(s): 01 Batch: WG2128538-2 WG2128538-3								
Pentachlorophenol	117		118		40-140	1		40
Hexachlorobenzene	81		86		40-140	6		40
Hexachloroethane	47		50		40-140	6		40

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria
2-Fluorophenol	32		33		21-120
Phenol-d6	31		31		10-120
Nitrobenzene-d5	78		78		23-120
2-Fluorobiphenyl	69		70		15-120
2,4,6-Tribromophenol	**129**	Q	**128**	Q	10-120
4-Terphenyl-d14	61		61		41-149

PCBS

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

SAMPLE RESULTS

Lab ID: L2565314-01
Client ID: P6TMW03_101525
Sample Location: SYRACUSE NY

Date Collected: 10/15/25 14:35
Date Received: 10/15/25
Field Prep: Refer to COC

Sample Depth:
Matrix: Water
Analytical Method: 1,8082A
Analytical Date: 10/17/25 10:17
Analyst: EMR

Extraction Method: EPA 3510C
Extraction Date: 10/16/25 15:18
Cleanup Method: EPA 3665A
Cleanup Date: 10/17/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/17/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/l	0.071	0.021	1	A
Aroclor 1221	ND		ug/l	0.071	0.026	1	A
Aroclor 1232	ND		ug/l	0.071	0.026	1	A
Aroclor 1242	ND		ug/l	0.071	0.026	1	A
Aroclor 1248	ND		ug/l	0.071	0.026	1	A
Aroclor 1254	ND		ug/l	0.071	0.026	1	A
Aroclor 1260	ND		ug/l	0.071	0.026	1	A
Aroclor 1262	ND		ug/l	0.071	0.026	1	A
Aroclor 1268	ND		ug/l	0.071	0.026	1	A
PCBs, Total	ND		ug/l	0.071	0.021	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	58		30-150	A
Decachlorobiphenyl	43		30-150	A
2,4,5,6-Tetrachloro-m-xylene	62		30-150	B
Decachlorobiphenyl	53		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8082A
Analytical Date: 10/17/25 09:42
Analyst: EMR

Extraction Method: EPA 3510C
Extraction Date: 10/16/25 15:18
Cleanup Method: EPA 3665A
Cleanup Date: 10/17/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/17/25

Parameter	Result	Qualifier	Units	RL	MDL	Column
Polychlorinated Biphenyls by GC - Westborough Lab for sample(s): 01 Batch: WG2128759-1						
Aroclor 1016	ND		ug/l	0.071	0.021	A
Aroclor 1221	ND		ug/l	0.071	0.026	A
Aroclor 1232	ND		ug/l	0.071	0.026	A
Aroclor 1242	ND		ug/l	0.071	0.026	A
Aroclor 1248	ND		ug/l	0.071	0.026	A
Aroclor 1254	ND		ug/l	0.071	0.026	A
Aroclor 1260	ND		ug/l	0.071	0.026	A
Aroclor 1262	ND		ug/l	0.071	0.026	A
Aroclor 1268	ND		ug/l	0.071	0.026	A
PCBs, Total	ND		ug/l	0.071	0.021	A

Surrogate	%Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	48		30-150	A
Decachlorobiphenyl	50		30-150	A
2,4,5,6-Tetrachloro-m-xylene	52		30-150	B
Decachlorobiphenyl	60		30-150	B

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits	Column
Polychlorinated Biphenyls by GC - Westborough Lab Associated sample(s): 01 Batch: WG2128759-2 WG2128759-3									
Aroclor 1016	66		65		40-140	1		50	A
Aroclor 1260	72		68		40-140	5		50	A

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	52		53		30-150	A
Decachlorobiphenyl	64		55		30-150	A
2,4,5,6-Tetrachloro-m-xylene	57		58		30-150	B
Decachlorobiphenyl	79		68		30-150	B

METALS

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

SAMPLE RESULTS

Lab ID: L2565314-01 Date Collected: 10/15/25 14:35

Client ID: P6TMW03_101525 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:

Matrix: Water

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	20.4		mg/l	0.0100	0.00327	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Antimony, Total	ND		mg/l	0.00400	0.00042	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Arsenic, Total	0.00720		mg/l	0.00050	0.00016	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Barium, Total	0.7262		mg/l	0.00050	0.00017	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Beryllium, Total	0.00169		mg/l	0.00050	0.00010	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Cadmium, Total	0.00039		mg/l	0.00020	0.00005	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Calcium, Total	608.		mg/l	2.00	0.788	20	10/16/25 11:58	10/22/25 13:09	EPA 3005A	1,6020B	CEY
Chromium, Total	0.03680		mg/l	0.00100	0.00017	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Cobalt, Total	0.03885		mg/l	0.00050	0.00016	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Copper, Total	0.07687		mg/l	0.00100	0.00038	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Iron, Total	45.7		mg/l	0.0500	0.0191	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Lead, Total	0.06024		mg/l	0.00100	0.00034	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Magnesium, Total	181.		mg/l	1.40	0.484	20	10/16/25 11:58	10/22/25 13:09	EPA 3005A	1,6020B	CEY
Manganese, Total	3.629		mg/l	0.00100	0.00044	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Mercury, Total	0.00021		mg/l	0.00020	0.00009	1	10/16/25 12:56	10/17/25 12:20	EPA 7470A	1,7470A	RDB
Nickel, Total	0.06286		mg/l	0.00200	0.00055	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Potassium, Total	3.30		mg/l	0.100	0.0309	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Selenium, Total	0.00731		mg/l	0.00500	0.00173	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Silver, Total	ND		mg/l	0.00040	0.00016	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Sodium, Total	52.7		mg/l	0.500	0.0293	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Thallium, Total	0.00029	J	mg/l	0.00100	0.00014	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Vanadium, Total	0.03982		mg/l	0.00500	0.00157	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
Zinc, Total	0.1026		mg/l	0.01000	0.00341	1	10/16/25 11:58	10/22/25 12:20	EPA 3005A	1,6020B	CEY
General Chemistry - Mansfield Lab											
Chromium, Trivalent	0.036	J	mg/l	0.050	0.015	1		10/22/25 12:20	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

SAMPLE RESULTS

Lab ID: L2565314-01 Date Collected: 10/15/25 14:35

Client ID: P6TMW03_101525 Date Received: 10/15/25

Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:

Matrix: Water

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Dissolved Metals - Mansfield Lab											
Aluminum, Dissolved	ND		mg/l	0.0100	0.00327	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Antimony, Dissolved	ND		mg/l	0.00400	0.00042	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Arsenic, Dissolved	0.00053		mg/l	0.00050	0.00016	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Barium, Dissolved	0.1390		mg/l	0.00050	0.00017	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Beryllium, Dissolved	ND		mg/l	0.00050	0.00010	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Cadmium, Dissolved	ND		mg/l	0.00020	0.00005	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Calcium, Dissolved	162.		mg/l	1.00	0.394	10	10/20/25 13:28	10/22/25 16:35	EPA 3005A	1,6020B	BLR
Chromium, Dissolved	ND		mg/l	0.00100	0.00017	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Cobalt, Dissolved	0.00106		mg/l	0.00050	0.00016	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Copper, Dissolved	0.00062	J	mg/l	0.00100	0.00038	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Iron, Dissolved	0.0230	J	mg/l	0.0500	0.0191	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Lead, Dissolved	ND		mg/l	0.00100	0.00034	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Magnesium, Dissolved	26.9		mg/l	0.0700	0.0242	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Manganese, Dissolved	0.7196		mg/l	0.00100	0.00044	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Mercury, Dissolved	ND		mg/l	0.00020	0.00009	1	10/20/25 14:17	10/21/25 14:57	EPA 7470A	1,7470A	JWN
Nickel, Dissolved	0.00125	J	mg/l	0.00200	0.00055	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Potassium, Dissolved	1.16		mg/l	0.100	0.0309	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Selenium, Dissolved	0.00517		mg/l	0.00500	0.00173	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Silver, Dissolved	ND		mg/l	0.00040	0.00016	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Sodium, Dissolved	53.6		mg/l	0.500	0.0293	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Thallium, Dissolved	ND		mg/l	0.00100	0.00014	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Vanadium, Dissolved	ND		mg/l	0.00500	0.00157	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR
Zinc, Dissolved	ND		mg/l	0.01000	0.00341	1	10/20/25 13:28	10/22/25 16:10	EPA 3005A	1,6020B	BLR

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

Method Blank Analysis
Batch Quality Control

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Total Metals - Mansfield Lab for sample(s): 01 Batch: WG2128674-1										
Aluminum, Total	ND		mg/l	0.0100	0.00327	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Antimony, Total	ND		mg/l	0.00400	0.00042	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Arsenic, Total	ND		mg/l	0.00050	0.00016	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Barium, Total	ND		mg/l	0.00050	0.00017	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Beryllium, Total	ND		mg/l	0.00050	0.00010	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Cadmium, Total	ND		mg/l	0.00020	0.00005	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Calcium, Total	ND		mg/l	0.100	0.0394	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Chromium, Total	ND		mg/l	0.00100	0.00017	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Cobalt, Total	ND		mg/l	0.00050	0.00016	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Copper, Total	ND		mg/l	0.00100	0.00038	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Iron, Total	ND		mg/l	0.0500	0.0191	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Lead, Total	ND		mg/l	0.00100	0.00034	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Magnesium, Total	ND		mg/l	0.0700	0.0242	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Manganese, Total	ND		mg/l	0.00100	0.00044	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Nickel, Total	ND		mg/l	0.00200	0.00055	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Potassium, Total	ND		mg/l	0.100	0.0309	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Selenium, Total	ND		mg/l	0.00500	0.00173	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Silver, Total	ND		mg/l	0.00040	0.00016	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Sodium, Total	ND		mg/l	0.500	0.0293	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Thallium, Total	0.00015	J	mg/l	0.00100	0.00014	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Vanadium, Total	ND		mg/l	0.00500	0.00157	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA
Zinc, Total	ND		mg/l	0.01000	0.00341	1	10/16/25 11:58	10/19/25 20:07	1,6020B	TAA

Prep Information

Digestion Method: EPA 3005A

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Total Metals - Mansfield Lab for sample(s): 01 Batch: WG2128676-1										
Mercury, Total	ND		mg/l	0.00020	0.00009	1	10/16/25 12:56	10/17/25 08:05	1,7470A	RDB

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

Method Blank Analysis
Batch Quality Control

Prep Information

Digestion Method: EPA 7470A

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Dissolved Metals - Mansfield Lab for sample(s): 01 Batch: WG2130170-1										
Aluminum, Dissolved	ND		mg/l	0.0100	0.00327	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Antimony, Dissolved	ND		mg/l	0.00400	0.00042	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Arsenic, Dissolved	0.00020	J	mg/l	0.00050	0.00016	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Barium, Dissolved	ND		mg/l	0.00050	0.00017	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Beryllium, Dissolved	ND		mg/l	0.00050	0.00010	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Cadmium, Dissolved	ND		mg/l	0.00020	0.00005	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Calcium, Dissolved	ND		mg/l	0.100	0.0394	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Chromium, Dissolved	ND		mg/l	0.00100	0.00017	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Cobalt, Dissolved	ND		mg/l	0.00050	0.00016	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Copper, Dissolved	ND		mg/l	0.00100	0.00038	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Iron, Dissolved	ND		mg/l	0.0500	0.0191	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Lead, Dissolved	ND		mg/l	0.00100	0.00034	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Magnesium, Dissolved	ND		mg/l	0.0700	0.0242	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Manganese, Dissolved	ND		mg/l	0.00100	0.00044	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Nickel, Dissolved	ND		mg/l	0.00200	0.00055	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Potassium, Dissolved	ND		mg/l	0.100	0.0309	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Selenium, Dissolved	ND		mg/l	0.00500	0.00173	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Silver, Dissolved	ND		mg/l	0.00040	0.00016	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Sodium, Dissolved	0.118	J	mg/l	0.500	0.0293	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Thallium, Dissolved	0.00019	J	mg/l	0.00100	0.00014	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Vanadium, Dissolved	ND		mg/l	0.00500	0.00157	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR
Zinc, Dissolved	ND		mg/l	0.01000	0.00341	1	10/20/25 13:28	10/22/25 15:51	1,6020B	BLR

Prep Information

Digestion Method: EPA 3005A

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Method Blank Analysis
Batch Quality Control

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Dissolved Metals - Mansfield Lab for sample(s): 01 Batch: WG2130171-1										
Mercury, Dissolved	ND		mg/l	0.00020	0.00009	1	10/20/25 14:17	10/21/25 13:37	1,7470A	JWN

Prep Information

Digestion Method: EPA 7470A

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01 Batch: WG2128674-2								
Aluminum, Total	110		-		80-120	-		
Antimony, Total	90		-		80-120	-		
Arsenic, Total	108		-		80-120	-		
Barium, Total	111		-		80-120	-		
Beryllium, Total	112		-		80-120	-		
Cadmium, Total	107		-		80-120	-		
Calcium, Total	117		-		80-120	-		
Chromium, Total	112		-		80-120	-		
Cobalt, Total	111		-		80-120	-		
Copper, Total	113		-		80-120	-		
Iron, Total	114		-		80-120	-		
Lead, Total	102		-		80-120	-		
Magnesium, Total	108		-		80-120	-		
Manganese, Total	111		-		80-120	-		
Nickel, Total	114		-		80-120	-		
Potassium, Total	111		-		80-120	-		
Selenium, Total	109		-		80-120	-		
Silver, Total	107		-		80-120	-		
Sodium, Total	115		-		80-120	-		
Thallium, Total	102		-		80-120	-		
Vanadium, Total	114		-		80-120	-		

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	LCSD %Recovery	%Recovery Limits	RPD	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01 Batch: WG2128674-2					
Zinc, Total	112	-	80-120	-	
Total Metals - Mansfield Lab Associated sample(s): 01 Batch: WG2128676-2					
Mercury, Total	85	-	80-120	-	20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	LCSD %Recovery	%Recovery Limits	RPD	RPD Limits
Dissolved Metals - Mansfield Lab Associated sample(s): 01 Batch: WG2130170-2					
Aluminum, Dissolved	100	-	80-120	-	
Antimony, Dissolved	85	-	80-120	-	
Arsenic, Dissolved	104	-	80-120	-	
Barium, Dissolved	103	-	80-120	-	
Beryllium, Dissolved	106	-	80-120	-	
Cadmium, Dissolved	101	-	80-120	-	
Calcium, Dissolved	109	-	80-120	-	
Chromium, Dissolved	102	-	80-120	-	
Cobalt, Dissolved	101	-	80-120	-	
Copper, Dissolved	104	-	80-120	-	
Iron, Dissolved	101	-	80-120	-	
Lead, Dissolved	103	-	80-120	-	
Magnesium, Dissolved	105	-	80-120	-	
Manganese, Dissolved	101	-	80-120	-	
Nickel, Dissolved	102	-	80-120	-	
Potassium, Dissolved	109	-	80-120	-	
Selenium, Dissolved	102	-	80-120	-	
Silver, Dissolved	99	-	80-120	-	
Sodium, Dissolved	116	-	80-120	-	
Thallium, Dissolved	113	-	80-120	-	
Vanadium, Dissolved	103	-	80-120	-	

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	LCSD %Recovery	%Recovery Limits	RPD	RPD Limits
Dissolved Metals - Mansfield Lab Associated sample(s): 01 Batch: WG2130170-2					
Zinc, Dissolved	104	-	80-120	-	
Dissolved Metals - Mansfield Lab Associated sample(s): 01 Batch: WG2130171-2					
Mercury, Dissolved	96	-	80-120	-	

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01	QC Batch ID: WG2128674-3	WG2128674-4	QC Sample: L2564730-01	Client ID: MS Sample								
Aluminum, Total	0.0120	2	2.21	110		2.20	109		75-125	0		20
Antimony, Total	ND	0.5	0.4978	100		0.4905	98		75-125	1		20
Arsenic, Total	0.00182	0.12	0.1341	110		0.1366	112		75-125	2		20
Barium, Total	0.2105	2	2.442	112		2.415	110		75-125	1		20
Beryllium, Total	ND	0.05	0.05428	108		0.05388	108		75-125	1		20
Cadmium, Total	ND	0.053	0.05646	106		0.05668	107		75-125	0		20
Calcium, Total	247.	10	256	90		260	**130**	Q	75-125	2		20
Chromium, Total	0.00036J	0.2	0.2337	117		0.2322	116		75-125	1		20
Cobalt, Total	0.00115	0.5	0.5815	116		0.5779	115		75-125	1		20
Copper, Total	ND	0.25	0.2881	115		0.2854	114		75-125	1		20
Iron, Total	0.981	1	2.21	123		2.20	122		75-125	0		20
Lead, Total	ND	0.53	0.5697	107		0.5668	107		75-125	1		20
Magnesium, Total	20.6	10	31.8	112		32.1	115		75-125	1		20
Manganese, Total	0.3424	0.5	0.9116	114		0.9043	112		75-125	1		20
Nickel, Total	0.07247	0.5	0.6657	119		0.6556	117		75-125	2		20
Potassium, Total	16.8	10	27.7	109		28.2	114		75-125	2		20
Selenium, Total	ND	0.12	0.118	98		0.121	101		75-125	3		20
Silver, Total	ND	0.05	0.05406	108		0.05394	108		75-125	0		20
Sodium, Total	296.	10	294	**0**	Q	304	80		75-125	3		20

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2128674-3 WG2128674-4 QC Sample: L2564730-01 Client ID: MS Sample												
Thallium, Total	ND	0.12	0.1279	106		0.1273	106		75-125	0		20
Vanadium, Total	ND	0.5	0.6082	122		0.5958	119		75-125	2		20
Zinc, Total	1.413	0.5	2.355	**188**	Q	2.372	**192**	Q	75-125	1		20
Total Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2128676-3 WG2128676-4 QC Sample: L2564730-01 Client ID: MS Sample												
Mercury, Total	ND	0.005	0.00444	89		0.00445	89		75-125	0		20

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Dissolved Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2130170-3 QC Sample: L2564894-01 Client ID: MS Sample												
Aluminum, Dissolved	0.014	2	2.06	103		-	-		75-125	-		
Antimony, Dissolved	ND	0.5	0.5121	102		-	-		75-125	-		
Arsenic, Dissolved	1.224	0.12	1.375	**126**	Q	-	-		75-125	-		
Barium, Dissolved	0.1919	2	2.261	104		-	-		75-125	-		
Beryllium, Dissolved	ND	0.05	0.05263	105		-	-		75-125	-		
Cadmium, Dissolved	ND	0.053	0.05339	101		-	-		75-125	-		
Calcium, Dissolved	126	10	138	**140**	Q	-	-		75-125	-		
Chromium, Dissolved	0.0019	0.2	0.2058	103		-	-		75-125	-		
Cobalt, Dissolved	0.0014	0.5	0.5137	103		-	-		75-125	-		
Copper, Dissolved	ND	0.25	0.2607	104		-	-		75-125	-		
Iron, Dissolved	211	1	249	**600**	Q	-	-		75-125	-		
Lead, Dissolved	ND	0.53	0.5541	104		-	-		75-125	-		
Magnesium, Dissolved	30.1	10	45.0	116		-	-		75-125	-		
Manganese, Dissolved	5.566	0.5	7.281	124		-	-		75-125	-		
Nickel, Dissolved	0.0022	0.5	0.5219	104		-	-		75-125	-		
Potassium, Dissolved	17.4	10	27.9	109		-	-		75-125	-		
Selenium, Dissolved	ND	0.12	0.127	106		-	-		75-125	-		
Silver, Dissolved	ND	0.05	0.04943	99		-	-		75-125	-		
Sodium, Dissolved	28.0	10	41.6	114		-	-		75-125	-		

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565314
Report Date: 10/29/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Dissolved Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2130170-3 QC Sample: L2564894-01 Client ID: MS Sample												
Thallium, Dissolved	ND	0.12	0.1240	103		-	-		75-125	-		
Vanadium, Dissolved	0.0068	0.5	0.5250	105		-	-		75-125	-		
Zinc, Dissolved	ND	0.5	0.5212	104		-	-		75-125	-		
Dissolved Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2130171-3 QC Sample: L2565252-01 Client ID: MS Sample												
Mercury, Dissolved	0.00009J	0.005	0.00495	99		-	-		75-125	-		

Lab Duplicate Analysis

Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI

Project Number: 170859701

Lab Number: L2565314

Report Date: 10/29/25

Parameter	Native Sample	Duplicate Sample	Units	RPD	Qual	RPD Limits
Dissolved Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2130170-4 QC Sample: L2564894-01 Client ID: DUP Sample						
Cadmium, Dissolved	ND	ND	mg/l	NC		20
Lead, Dissolved	ND	ND	mg/l	NC		20
Dissolved Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2130170-4 QC Sample: L2564894-01 Client ID: DUP Sample						
Arsenic, Dissolved	1.224	1.208	mg/l	1		20
Dissolved Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2130171-4 QC Sample: L2565252-01 Client ID: DUP Sample						
Mercury, Dissolved	0.00009J	ND	mg/l	NC		20

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Serial Dilution Analysis
Batch Quality Control

Lab Number: L2565314
Report Date: 10/29/25

Parameter	Native Sample	Serial Dilution	Units	% D	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2128674-6 QC Sample: L2564730-01 Client ID: DUP Sample						
Zinc, Total	1.413	1.704	mg/l	**21**	Q	20

INORGANICS
&
MISCELLANEOUS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

SAMPLE RESULTS

Lab ID: L2565314-01
Client ID: P6TMW03_101525
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Water

Date Collected: 10/15/25 14:35
Date Received: 10/15/25
Field Prep: Refer to COC

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Cyanide, Total	0.002	J	mg/l	0.005	0.001	1	10/21/25 20:30	10/22/25 12:16	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/l	0.050	0.015	5	10/16/25 13:30	10/16/25 13:57	1,7196A	DMO

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

Method Blank Analysis
Batch Quality Control

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab for sample(s): 01 Batch: WG2128680-1										
Chromium, Hexavalent	ND		mg/l	0.010	0.003	1	10/16/25 13:30	10/16/25 13:55	1,7196A	DMO
General Chemistry - Westborough Lab for sample(s): 01 Batch: WG2130872-1										
Cyanide, Total	ND		mg/l	0.005	0.001	1	10/21/25 20:30	10/22/25 11:48	1,9010C/9012B	JER

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565314
Report Date: 10/29/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
General Chemistry - Westborough Lab Associated sample(s): 01 Batch: WG2128680-2								
Chromium, Hexavalent	94		-		85-115	-		
General Chemistry - Westborough Lab Associated sample(s): 01 Batch: WG2130872-2 WG2130872-3								
Cyanide, Total	108		95		85-115	13		20

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565314
Report Date: 10/29/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
General Chemistry - Westborough Lab Associated sample(s): 01 QC Batch ID: WG2128680-4 QC Sample: L2565314-01 Client ID: P6TMW03_101525												
Chromium, Hexavalent	ND	0.5	0.494	99		-	-		85-115	-		
General Chemistry - Westborough Lab Associated sample(s): 01 QC Batch ID: WG2130872-4 WG2130872-5 QC Sample: L2565387-09 Client ID: MS Sample												
Cyanide, Total	0.001J	0.2	0.164	82		0.210	105		80-120	**25**	Q	20

Lab Duplicate Analysis

Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI

Project Number: 170859701

Lab Number: L2565314

Report Date: 10/29/25

Parameter	Native Sample	Duplicate Sample	Units	RPD	Qual	RPD Limits
General Chemistry - Westborough Lab Associated sample(s): 01 QC Batch ID: WG2128680-3 QC Sample: L2565314-01 Client ID: P6TMW03_101525						
Chromium, Hexavalent	ND	ND	mg/l	NC		20

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565314
Report Date: 10/29/25

Sample Receipt and Container Information

Were project specific reporting limits specified? YES

Cooler Information

Cooler	Custody Seal
A	Absent
B	Absent

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565314-01A	Vial HCl preserved	NA	NA			Y	Absent		NYTCL-8260(14)
L2565314-01B	Vial HCl preserved	NA	NA			Y	Absent		NYTCL-8260(14)
L2565314-01C	Vial HCl preserved	NA	NA			Y	Absent		NYTCL-8260(14)
L2565314-01D	Amber 100ml unpreserved	NA	NA			Y	Absent		NYTCL-8082-RVT(365)
L2565314-01E	Amber 100ml unpreserved	NA	NA			Y	Absent		NYTCL-8082-RVT(365)
L2565314-01F	Amber 100ml unpreserved	NA	NA			Y	Absent		L-EXT-8081(7)
L2565314-01G	Amber 100ml unpreserved	NA	NA			Y	Absent		L-EXT-8081(7)
L2565314-01H	Amber 100ml unpreserved	NA	NA			Y	Absent		NYTCL-8270-RVT(7),NYTCL-8270-SIM-RVT(7)
L2565314-01J	Amber 100ml unpreserved	NA	NA			Y	Absent		NYTCL-8270-RVT(7),NYTCL-8270-SIM-RVT(7)
L2565314-01L	Plastic 250ml NaOH preserved	NA	>12	>12		Y	Absent		TCN-9010(14)
L2565314-01M	Plastic 250ml HNO3 preserved	NA	<2	<2		Y	Absent		CU-6020S(180),SE-6020S(180),V-6020S(180),K-6020S(180),MN-6020S(180),CO-6020S(180),ZN-6020S(180),BE-6020S(180),MG-6020S(180),CR-6020S(180),CA-6020S(180),FE-6020S(180),TL-6020S(180),BA-6020S(180),NI-6020S(180),NA-6020S(180),PB-6020S(180),SB-6020S(180),AS-6020S(180),AG-6020S(180),CD-6020S(180),AL-6020S(180),HG-S(28)

*Values in parentheses indicate holding time in days

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565314
Report Date: 10/29/25

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565314-01N	Plastic 250ml HNO3 preserved	NA	<2	<2		Y	Absent		SE-6020T(180),BA-6020T(180),TL-6020T(180),FE-6020T(180),K-6020T(180),NI-6020T(180),CA-6020T(180),CR-6020T(180),NA-6020T(180),ZN-6020T(180),CU-6020T(180),PB-6020T(180),MN-6020T(180),BE-6020T(180),AS-6020T(180),V-6020T(180),SB-6020T(180),AG-6020T(180),AL-6020T(180),HG-T(28),MG-6020T(180),CD-6020T(180),CO-6020T(180)
L2565314-01O	Plastic 250ml unpreserved	NA	NA			Y	Absent		HEXCR-7196(1)
L2565314-01P	Amber 1L unpreserved	NA	NA			Y	Absent		L-EXT-8151(7)
L2565314-01Q	Amber 1L unpreserved	NA	NA			Y	Absent		L-EXT-8151(7)

*Values in parentheses indicate holding time in days

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565314
Project Number:	170859701	**Report Date:**	10/29/25

GLOSSARY

Acronyms

DL - Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the limit of quantitation (LOQ). The DL includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)

EDL - Estimated Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the reporting limit (RL). The EDL includes any adjustments from dilutions, concentrations or moisture content, where applicable. The use of EDLs is specific to the analysis of PAHs using Solid-Phase Microextraction (SPME).

EMPC - Estimated Maximum Possible Concentration: The concentration that results from the signal present at the retention time of an analyte when the ions meet all of the identification criteria except the ion abundance ratio criteria. An EMPC is a worst-case estimate of the concentration.

EPA - Environmental Protection Agency.

LCS - Laboratory Control Sample: A sample matrix, free from the analytes of interest, spiked with verified known amounts of analytes or a material containing known and verified amounts of analytes.

LCSD - Laboratory Control Sample Duplicate: Refer to LCS.

LFB - Laboratory Fortified Blank: A sample matrix, free from the analytes of interest, spiked with verified known amounts of analytes or a material containing known and verified amounts of analytes.

LOD - Limit of Detection: This value represents the level to which a target analyte can reliably be detected for a specific analyte in a specific matrix by a specific method. The LOD includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)

LOQ - Limit of Quantitation: The value at which an instrument can accurately measure an analyte at a specific concentration. The LOQ includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)

Limit of Quantitation: The value at which an instrument can accurately measure an analyte at a specific concentration. The LOQ includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)

MDL - Method Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the reporting limit (RL). The MDL includes any adjustments from dilutions, concentrations or moisture content, where applicable.

MS - Matrix Spike Sample: A sample prepared by adding a known mass of target analyte to a specified amount of matrix sample for which an independent estimate of target analyte concentration is available. For Method 332.0, the spike recovery is calculated using the native concentration, including estimated values.

MSD - Matrix Spike Sample Duplicate: Refer to MS.

NA - Not Applicable.

NC - Not Calculated: Term is utilized when one or more of the results utilized in the calculation are non-detect at the parameter's reporting unit.

NDPA/DPA - N-Nitrosodiphenylamine/Diphenylamine.

NI - Not Ignitable.

NP - Non-Plastic: Term is utilized for the analysis of Atterberg Limits in soil.

NR - No Results: Term is utilized when 'No Target Compounds Requested' is reported for the analysis of Volatile or Semivolatile Organic TIC only requests.

RL - Reporting Limit: The value at which an instrument can accurately measure an analyte at a specific concentration. The RL includes any adjustments from dilutions, concentrations or moisture content, where applicable.

RPD - Relative Percent Difference: The results from matrix and/or matrix spike duplicates are primarily designed to assess the precision of analytical results in a given matrix and are expressed as relative percent difference (RPD). Values which are less than five times the reporting limit for any individual parameter are evaluated by utilizing the absolute difference between the values; although the RPD value will be provided in the report.

SRM - Standard Reference Material: A reference sample of a known or certified value that is of the same or similar matrix as the associated field samples.

STLP - Semi-dynamic Tank Leaching Procedure per EPA Method 1315.

TEF - Toxic Equivalency Factors: The values assigned to each dioxin and furan to evaluate their toxicity relative to 2,3,7,8-TCDD.

TEQ - Toxic Equivalent: The measure of a sample's toxicity derived by multiplying each dioxin and furan by its corresponding TEF and then summing the resulting values.

TIC - Tentatively Identified Compound: A compound that has been identified to be present and is not part of the target compound list (TCL) for the method and/or program. All TICs are qualitatively identified and reported as estimated concentrations.

Report Format: DU Report with 'J' Qualifiers

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565314
Project Number:	170859701	**Report Date:**	10/29/25

Footnotes

1 - The reference for this analyte should be considered modified since this analyte is absent from the target analyte list of the original method.

Terms

Analytical Method: Both the document from which the method originates and the analytical reference method. (Example: EPA 8260B is shown as 1,8260B.) The codes for the reference method documents are provided in the References section of the Addendum.

Chlordane: The target compound Chlordane (CAS No. 57-74-9) is reported for GC ECD analyses. Per EPA,this compound "refers to a mixture of chlordane isomers, other chlorinated hydrocarbons and numerous other components." (Reference: USEPA Toxicological Review of Chlordane, In Support of Summary Information on the Integrated Risk Information System (IRIS), December 1997.)

Difference: With respect to Total Oxidizable Precursor (TOP) Assay analysis, the difference is defined as the Post-Treatment value minus the Pre-Treatment value.

Final pH: As it pertains to Sample Receipt & Container Information section of the report, Final pH reflects pH of container determined after adjustment at the laboratory, if applicable. If no adjustment required, value reflects Initial pH.

Frozen Date/Time: With respect to Volatile Organics in soil, Frozen Date/Time reflects the date/time at which associated Reagent Water-preserved vials were initially frozen. Note: If frozen date/time is beyond 48 hours from sample collection, value will be reflected in 'bold'.

Gasoline Range Organics (GRO): Gasoline Range Organics (GRO) results include all chromatographic peaks eluting from Methyl tert butyl ether through Naphthalene, with the exception of GRO analysis in support of State of Ohio programs, which includes all chromatographic peaks eluting from Hexane through Dodecane.

Initial pH: As it pertains to Sample Receipt & Container Information section of the report, Initial pH reflects pH of container determined upon receipt, if applicable.

PAH Total: With respect to Alkylated PAH analyses, the 'PAHs, Total' result is defined as the summation of results for all or a subset of the following compounds: Naphthalene, C1-C4 Naphthalenes, 2-Methylnaphthalene, 1-Methylnaphthalene, Biphenyl, Acenaphthylene, Acenaphthene, Fluorene, C1-C3 Fluorenes, Phenanthrene, C1-C4 Phenanthrenes/Anthracenes, Anthracene, Fluoranthene, Pyrene, C1-C4 Fluoranthenes/Pyrenes, Benz(a)anthracene, Chrysene, C1-C4 Chrysenes, Benzo(b)fluoranthene, Benzo(j)+(k)fluoranthene, Benzo(e)pyrene, Benzo(a)pyrene, Perylene, Indeno(1,2,3-cd)pyrene, Dibenz(ah)+(ac)anthracene, Benzo(g,h,i)perylene. If a 'Total' result is requested, the results of its individual components will also be reported.

PFAS Total: With respect to PFAS analyses, the 'PFAS, Total (5)' result is defined as the summation of results for: PFHpA, PFHxS, PFOA, PFNA and PFOS. In addition, the 'PFAS, Total (6)' result is defined as the summation of results for: PFHpA, PFHxS, PFOA, PFNA, PFDA and PFOS. For MassDEP DW compliance analysis only, the 'PFAS, Total (6)' result is defined as the summation of results at or above the RL. Note: If a 'Total' result is requested, the results of its individual components will also be reported.

Total: With respect to Organic analyses, a 'Total' result is defined as the summation of results for individual isomers or Aroclors. If a 'Total' result is requested, the results of its individual components will also be reported. This is applicable to 'Total' results for methods 8260, 8081 and 8082.

Data Qualifiers

A - Spectra identified as "Aldol Condensates" are byproducts of the extraction/concentration procedures when acetone is introduced in the process.

B - The analyte was detected above the reporting limit in the associated method blank. Flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank. For MCP-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank. For DOD-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank AND the analyte was detected above one-half the reporting limit (or above the reporting limit for common lab contaminants) in the associated method blank. For NJ-Air-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte above the reporting limit. For NJ-related projects (excluding Air), flag only applies to associated field samples that have detectable concentrations of the analyte, which was detected above the reporting limit in the associated method blank or above five times the reporting limit for common lab contaminants (Phthalates, Acetone, Methylene Chloride, 2-Butanone).

C - Co-elution: The target analyte co-elutes with a known lab standard (i.e. surrogate, internal standards, etc.) for co-extracted analyses.

D - Concentration of analyte was quantified from diluted analysis. Flag only applies to field samples that have detectable concentrations of the analyte.

E - Concentration of analyte exceeds the range of the calibration curve and/or linear range of the instrument.

F - The ratio of quantifier ion response to qualifier ion response falls outside of the laboratory criteria. Results are considered to be an estimated maximum concentration.

G - The concentration may be biased high due to matrix interferences (i.e, co-elution) with non-target compound(s). The result should be considered estimated.

H - The analysis of pH was performed beyond the regulatory-required holding time of 15 minutes from the time of sample collection.

I - The lower value for the two columns has been reported due to obvious interference.

J - Estimated value. The Target analyte concentration is below the quantitation limit (RL), but above the Method Detection Limit (MDL) or Estimated Detection Limit (EDL) for SPME-related analyses. This represents an estimated concentration for Tentatively Identified Compounds (TICs). For calculated parameters, this represents that one or more values used in the calculation were

Report Format: DU Report with 'J' Qualifiers

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565314
Project Number:	170859701	**Report Date:**	10/29/25

Data Qualifiers

estimated.

M - Reporting Limit (RL) exceeds the MCP CAM Reporting Limit for this analyte.

ND - Not detected at the method detection limit (MDL) for the sample, or estimated detection limit (EDL) for SPME-related analyses.

NJ - Presumptive evidence of compound. This represents an estimated concentration for Tentatively Identified Compounds (TICs), where the identification is based on a mass spectral library search.

P - The RPD between the results for the two columns exceeds the method-specified criteria.

Q - The quality control sample exceeds the associated acceptance criteria. For DOD-related projects, LCS and/or Continuing Calibration Standard exceedences are also qualified on all associated sample results. Note: This flag is not applicable for matrix spike recoveries when the sample concentration is greater than 4x the spike added or for batch duplicate RPD when the sample concentrations are less than 5x the RL. (Metals only.)

R - Analytical results are from sample re-analysis.

RE - Analytical results are from sample re-extraction.

S - Analytical results are from modified screening analysis.

V - The surrogate associated with this target analyte has a recovery outside the QC acceptance limits. (Applicable to MassDEP DW Compliance samples only.)

Z - The batch matrix spike and/or duplicate associated with this target analyte has a recovery/RPD outside the QC acceptance limits. (Applicable to MassDEP DW Compliance samples only.)

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565314

Project Number: 170859701 **Report Date:** 10/29/25

REFERENCES

1 Test Methods for Evaluating Solid Waste: Physical/Chemical Methods. EPA SW-846. Third Edition. Updates I - VI, 2018.

107 Calculation method.

LIMITATION OF LIABILITIES

Pace Analytical Services performs services with reasonable care and diligence normal to the analytical testing laboratory industry. In the event of an error, the sole and exclusive responsibility of Pace Analytical Services shall be to re-perform the work at it's own expense. In no event shall Pace Analytical Services be held liable for any incidental, consequential or special damages, including but not limited to, damages in any way connected with the use of, interpretation of, information or analysis provided by Pace Analytical Services.

We strongly urge our clients to comply with EPA protocol regarding sample volume, preservation, cooling, containers, sampling procedures, holding time and splitting of samples in the field.

Certification Information

The following analytes are not included in our Primary NELAP Scope of Accreditation:

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581
EPA 624.1: m/p-xylene, o-xylene, Naphthalene
EPA 625.1: alpha-Terpineol
EPA 8260D: NPW: 1,2,4,5-Tetramethylbenzene; 4-Ethyltoluene; SCM: Iodomethane (methyl iodide), 1,2,4,5-Tetramethylbenzene; 4-Ethyltoluene.
EPA 8270E: NPW: Dimethylnaphthalene,1,4-Diphenylhydrazine, alpha-Terpineol, Azobenzene; SCM: Dimethylnaphthalene,1,4-Diphenylhydrazine.
SM4500: NPW: Amenable Cyanide; SCM: Total Phosphorus, TKN, NO2, NO3.

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
SM 2540D: TSS.
EPA TO-15: Halothane, 2,4,4-Trimethyl-2-pentene, 2,4,4-Trimethyl-1-pentene, Thiophene, 2-Methylthiophene, 3-Methylthiophene, 2-Ethylthiophene, 1,2,3-Trimethylbenzene, Indan, Indene, 1,2,4,5-Tetramethylbenzene, Benzothiophene, 1-Methylnaphthalene.
MADEP-APH.
Nonpotable Water: EPA RSK-175 Dissolved Gases
Biological Tissue Matrix: EPA 3050B

Mansfield Facility – 120 Forbes Blvd. Mansfield, MA 02048
EPA TO-15: Halothane, 2,4,4-Trimethyl-2-pentene, 2,4,4-Trimethyl-1-pentene, Thiophene, 2-Methylthiophene, 3-Methylthiophene, 2-Ethylthiophene, 1,2,3-Trimethylbenzene, Indan, Indene, 1,2,4,5-Tetramethylbenzene, Benzothiophene, 1-Methylnaphthalene.
Nonpotable Water: EPA RSK-175 Dissolved Gases

The following test method is not included in our New Jersey Secondary NELAP Scope of Accreditation:

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
Determination of Selected Perfluorinated Alkyl Substances by Solid Phase Extraction and Liquid Chromatography/Tandem Mass Spectrometry Isotope Dilution (via Alpha SOP 23528)

The following analytes are included in our Massachusetts DEP Scope of Accreditation

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581

Drinking Water
EPA 300.0: Chloride, Nitrate-N, Fluoride, Sulfate; **EPA 353.2**: Nitrate-N, Nitrite-N; **SM4500NO3-F**: Nitrate-N, Nitrite-N; **SM4500F-C, SM4500CN-CE, EPA 180.1, SM2130B, SM4500Cl-D, SM2320B, SM2540C, SM4500H-B, SM4500NO2-B**
EPA 524.2: THMs and VOCs; **EPA 504.1:** EDB, DBCP.
Microbiology: **SM9215B; SM9223-P/A, SM9223B-Colilert-QT,SM9222D**.

Non-Potable Water
SM4500H,B, EPA 120.1, SM2510B, SM2540C, SM2320B, SM4500CL-E, SM4500F-BC, SM4500NH3-BH: Ammonia-N and Kjeldahl-N, **EPA 350.1**: Ammonia-N, **LACHAT 10-107-06-1-B**: Ammonia-N, **EPA 351.1, SM4500NO3-F, EPA 353.2**: Nitrate-N**, SM4500P-E, SM4500P-B, E, SM4500SO4-E, SM5220D, EPA 410.4, SM5210B, SM5310C, SM4500CL-D, SM4500CL-G, EPA 1664, EPA 420.1, SM4500-CN-CE, SM2540D, EPA 300: Chloride, Sulfate, Nitrate.**
EPA 624.1: Volatile Halocarbons & Aromatics,
EPA 608.3: Chlordane, Toxaphene, Aldrin, alpha-BHC, beta-BHC, gamma-BHC, delta-BHC, Dieldrin, DDD, DDE, DDT, Endosulfan I, Endosulfan II, Endosulfan sulfate, Endrin, Endrin Aldehyde, Heptachlor, Heptachlor Epoxide, PCBs
EPA 625.1: SVOC (Acid/Base/Neutral Extractables).
Microbiology: **SM9223B-Colilert-QT; Enterolert-QT.**

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048

Drinking Water
EPA 200.7: Al, Ba, Cd, Cr, Cu, Fe, Mn, Ni, Na, Ag, Ca, Zn. **EPA 200.8:** Al, Sb, As, Ba, Be, Cd, Cr, Cu, Pb, Mn, Ni, Se, Ag, TL, Zn. **EPA 245.1** Hg.
EPA 522, EPA 537.1.

Non-Potable Water
EPA 200.7: Al, Sb, As, Be, Cd, Ca, Cr, Co, Cu, Fe, Pb, Mg, Mn, Mo, Ni, K, Se, Ag, Na, Sr, TL, Ti, V, Zn.
EPA 200.8: Al, Sb**,** As, Be, Cd, Ca, Cr, Cu, Fe, Pb, Mg, Mn, Ni, K, Se, Ag, Na, TL, Zn.
EPA 245.1: Hg. **EPA 245.7:** Hg.
SM2340B

Certification IDs:

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581
CT PH-0826, IL 200077, IN C-MA-03, KY kY98045, ME MA00086, MD 348, MA M-MA086, NH 2064, NJ MA935, NY 11148, NC (DW) 25700, NC (NPW/SCM) 666, OR MA-1316, PA 68-03671, RI LAO00065, TX T104704476, VT VT-0935, VA 460195

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
MA M-MA00030, CT PH-0825, ANAB/DoD L2474, IL 200081, IN C-MA-04, KY KY98046, LA 85084, ME MA00030, MI 9110, MN 025-999-495, NH 2062, NJ MA015, NY 11627, NC (NPW/SCM) 685, OR MA-0262, PA 68-02089, RI LAO00299, TX T-104704419, VT VT-0015, VA 460194, WA C954

Mansfield Facility – 120 Forbes Blvd. Mansfield, MA 02048
ANAB/DoD L2474, LA 245052, ME MA01156, MN 025-999-498, NH 2249, NJ MA025, NY 12191, OR 4203, TX T104704583, VA 460311, WA C1104.

For a complete listing of analytes and methods, please contact your Project Manager.

L2565314
LANGAN – NYC

NEW YORK CHAIN OF CUSTODY

ALPHA ANALYTICAL

Westborough, MA 01581
8 Walkup Dr.
TEL: 508-898-9220
FAX: 508-898-9193

Mansfield, MA 02048
320 Forbes Blvd
TEL: 508-822-9300
FAX: 508-822-3288

Service Centers
Mahwah, NJ 07430: 35 Whitney Rd, Suite 5
Albany, NY 12205: 14 Walker Way
Tonawanda, NY 14150: 275 Cooper Ave, Suite 105

Page 1 of 1

Date Rec'd in Lab: 10/16/25

Client Information

Client: Langan Engineering
Address: 368 9th Ave 8th Fl
New York, NY 12001
Phone: 212-479-5402
Fax:
Email: Lhaley@langan.com

Project Information

Project Name: East Adams Redevelopment Phase 1
Project Location: Syracuse, NY
Project #: 170859701
(Use Project name as Project #): ☐
Project Manager: Lexi Haley
ALPHAQuote #: 26297

Turn-Around Time

Standard: ☒ Due Date:
Rush (only if pre approved): ☐ # of Days:

Deliverables

☒ ASP-A ☐ ASP-B ☒ Same as Client info
☐ EQuIS (1 File) ☐ EQuIS (4 File) PO #:
☐ Other

Regulatory Requirement

☐ NY TOGS ☒ NY Part 375
☐ AWQ Standards ☐ NY CP-51
☐ NY Restricted Use ☐ Other
☐ NY Unrestricted Use
☐ NYC Sewer Discharge

Disposal Site Information

Please identify below location of applicable disposal facilities.
Disposal Facility:
☐ NJ ☐ NY
☐ Other:

These samples have been previously analyzed by Alpha ☐

Other project specific requirements/comments:

cc Keenan, Pdinardo, data management@langan.com

Please specify Metals or TAL.

ANALYSIS

Sample Filtration
☐ Done
☐ Lab to do
Preservation
☐ Lab to do
(Please Specify below)

ALPHA Lab ID (Lab Use Only)	Sample ID	Collection Date	Collection Time	Sample Matrix	Sampler's Initials	Part 375/ TCL VOCs + SVOCs	PCBs, Pest, Herbs, TAL Metals (including Hg) + Cr(VI)	Total Cyanide	Part 375/ SVOCs	TCL VOCs			Sample Specific Comments	Total Bottle
JL	~~PIITMW08_101525~~	~~10/15/25~~	~~1200~~	~~W~~	~~SG~~	~~*~~								
65314-1	P6 TMW03_101525	10/15/25	1415	W	SG	*	X	X	X	X	+			Diss metals field filtered, Hold post + herbs

Preservative Code:
A = None
B = HCl
C = HNO_3
D = H_2SO_4
E = NaOH
F = MeOH
G = $NaHSO_4$
H = $Na_2S_2O_3$
K/E = Zn Ac/NaOH
O = Other

Container Code
P = Plastic
A = Amber Glass
V = Vial
G = Glass
B = Bacteria Cup
C = Cube
O = Other
E = Encore
D = BOD Bottle

Westboro: Certification No: MA935
Mansfield: Certification No: MA015

Container Type	V	A	A	A				
Preservative	B		GE					

Relinquished By:	Date/Time	Received By:	Date/Time
Sarah Greesh	10/15/25	PMK	10/15/25 1600
	10/15/25 1630		10/15/25 1830
	10/15-25		10/15 2200
	10/16 0200		10/16 0200

Please print clearly, legibly and completely. Samples can not be logged in and turnaround time clock will not start until any ambiguities are resolved. BY EXECUTING THIS COC, THE CLIENT HAS READ AND AGREES TO BE BOUND BY ALPHA'S TERMS & CONDITIONS. (See reverse side.)

Form No: 01-25 HC (rev. 30-Sept-2013)

Sample Delivery Group Summary

Pace Job Number : L2565314
Received : 15-OCT-2025
Reviewer : Mohammed Wahed

Account Name : Langan Engineering & Environmental
Project Number : 170859701
Project Name : EAST ADAMS REDEVELOPMENT PHVI

Delivery Information

Samples Delivered By : Pace Courier

Chain of Custody : Present

Cooler Information

Cooler	Seal/Seal#	Preservation	Temperature(°C)	Additional Information
A	Absent/	Ice	4.4	
B	Absent/	Ice	4.0	

Condition Information

1) All samples on COC received?	**YES**
2) Extra samples received?	**NO**
3) Are there any sample container discrepancies?	**NO**
4) Are there any discrepancies between COC & sample labels? L2565314-01: 15-OCT-25 14:15 vs. 15-OCT-25 14:35	**YES**
5) Are samples in appropriate containers for requested analysis?	**YES**
6) Are samples properly preserved for requested analysis?	**YES**
7) Are samples within holding time for requested analysis?	**YES**
8) All sampling equipment returned?	**NA**

Volatile Organics/VPH

1) Reagent Water Vials Frozen by Client?	**NO**

ANALYTICAL REPORT

Lab Number:	L2565713
Client:	Langan Engineering & Environmental 21 Penn Plaza 360 West 31st Street, 8th Floor New York, NY 10001-2727
ATTN:	Lexi Haley
Phone:	(212) 479-5499
Project Name:	EAST ADAMS REDEVELOPMENT PHVI
Project Number:	170859701
Report Date:	10/30/25

The original project report/data package is held by Pace Analytical Services. This report/data package is paginated and should be reproduced only in its entirety. Pace Analytical Services holds no responsibility for results and/or data that are not consistent with the original.

Certifications & Approvals: MA (M-MA086), NH NELAP (2064), CT (PH-0826), IL (200077), IN (C-MA-03), KY (KY98045), ME (MA00086), MD (348), NJ (MA935), NY (11148), NC (25700/666), OR (MA-1316), PA (68-03671), RI (LAO00065), TX (T104704476), VT (VT-0935), VA (460195), USDA (Permit #525-23-122-91930A1).

Eight Walkup Drive, Westborough, MA 01581-1019
508-898-9220 (Fax) 508-898-9193 800-624-9220 - www.alphalab.com

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565713
Report Date: 10/30/25

Lab Sample ID	Client ID	Matrix	Sample Location	Collection Date/Time	Receive Date
L2565713-01	P6TMW02_101625	WATER	SYRACUSE NY	10/16/25 11:00	10/16/25
L2565713-02	P6TMW10_101625	WATER	SYRACUSE NY	10/16/25 10:40	10/16/25
L2565713-03	P6TMW09_101625		SYRACUSE NY	10/16/25 01:00	10/16/25
L2565713-04	P6TMW09_101625	WATER	SYRACUSE NY	10/16/25 15:20	10/16/25

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565713
Project Number:	170859701	**Report Date:**	10/30/25

Case Narrative

The samples were received in accordance with the Chain of Custody and no significant deviations were encountered during the preparation or analysis unless otherwise noted. Sample Receipt, Container Information, and the Chain of Custody are located at the back of the report.

Results contained within this report relate only to the samples submitted under this Pace Lab Number and meet NELAP requirements for all NELAP accredited parameters unless otherwise noted in the following narrative. The data presented in this report is organized by parameter (i.e. VOC, SVOC, etc.). Sample specific Quality Control data (i.e. Surrogate Spike Recovery) is reported at the end of the target analyte list for each individual sample, followed by the Laboratory Batch Quality Control at the end of each parameter. Tentatively Identified Compounds (TICs), if requested, are reported for compounds identified to be present and are not part of the method/program Target Compound List, even if only a subset of the TCL are being reported. If a sample was re-analyzed or re-extracted due to a required quality control corrective action and if both sets of data are reported, the Laboratory ID of the re-analysis or re-extraction is designated with an "R" or "RE", respectively.

When multiple Batch Quality Control elements are reported (e.g. more than one LCS), the associated samples for each element are noted in the grey shaded header line of each data table. Any Laboratory Batch, Sample Specific % recovery or RPD value that is outside the listed Acceptance Criteria is bolded in the report. In reference to questions H (CAM) or 4 (RCP) when "NO" is checked, the performance criteria for CAM and RCP methods allow for some quality control failures to occur and still be within method compliance. In these instances, the specific failure is not narrated but noted in the associated QC Outlier Summary Report, located directly after the Case Narrative. QC information is also incorporated in the Data Usability Assessment table (Format 11) of our Data Merger tool, where it can be reviewed in conjunction with the sample result, associated regulatory criteria and any associated data usability implications.

Soil/sediments and solids are reported on a dry weight basis unless otherwise noted. Tissues are reported "as received" or on a wet weight basis, unless otherwise noted. Definitions of all data qualifiers and acronyms used in this report are provided in the Glossary located at the back of the report.

HOLD POLICY - For samples submitted on hold, Pace's policy is to hold samples (with the exception of Air canisters) free of charge for 21 calendar days from the date the project is completed. After 21 calendar days, we will dispose of all samples submitted including those put on hold unless you have contacted your Pace Project Manager and made arrangements for Pace to continue to hold the samples. Air canisters will be disposed after 3 business days from the date the project is completed.

Please contact Project Management at 800-624-9220 with any questions.

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565713
Project Number:	170859701	**Report Date:**	10/30/25

Case Narrative (continued)

Report Submission

October 30, 2025: This final report includes the results of all requested analyses. Additional requests will be reported separately.

October 23, 2025: This is a preliminary report. Please note that your project has contingency samples on hold. Contact your project manager to request additional analyses within 3 business days of receiving this report. Requests made after this time frame will be reported separately.

All non-detect (ND) or estimated concentrations (J-qualified) have been quantitated to the limit noted in the MDL column.

Sample Receipt

L2565713-01, -02, and -04: The collection time was specified by the client.

L2565713-01 and -02: The analysis performed was specified by the client.

L2565713-03: A sample identified as "P6TMW09_101625" was listed on the chain of custody, but not received. This was verified by the client.

Dissolved Metals

L2565713-01: The sample has elevated detection limits for all elements, with the exception of mercury, due to the dilution required by the sample matrix.

Chromium, Hexavalent

L2565713-01: The sample has an elevated detection limit due to the dilution required by the sample matrix.

I, the undersigned, attest under the pains and penalties of perjury that, to the best of my knowledge and belief and based upon my personal inquiry of those responsible for providing the information contained in this analytical report, such information is accurate and complete. This certificate of analysis is not complete unless this page accompanies any and all pages of this report.

Authorized Signature: Cristin Walker

Title: Technical Director/Representative Date: 10/30/25

ORGANICS

VOLATILES

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-01 Date Collected: 10/16/25 11:00

Client ID: P6TMW02_101625 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:

Matrix: Water

Analytical Method: 1,8260D

Analytical Date: 10/23/25 09:46

Analyst: MJV

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by GC/MS - Westborough Lab						
Methylene chloride	ND		ug/l	2.5	0.70	1
1,1-Dichloroethane	ND		ug/l	2.5	0.70	1
Chloroform	ND		ug/l	2.5	0.70	1
Carbon tetrachloride	ND		ug/l	0.50	0.13	1
1,2-Dichloropropane	ND		ug/l	1.0	0.14	1
Dibromochloromethane	ND		ug/l	0.50	0.15	1
1,1,2-Trichloroethane	ND		ug/l	1.5	0.50	1
Tetrachloroethene	ND		ug/l	0.50	0.18	1
Chlorobenzene	ND		ug/l	2.5	0.70	1
Trichlorofluoromethane	ND		ug/l	2.5	0.70	1
1,2-Dichloroethane	ND		ug/l	0.50	0.13	1
1,1,1-Trichloroethane	ND		ug/l	2.5	0.70	1
Bromodichloromethane	ND		ug/l	0.50	0.19	1
trans-1,3-Dichloropropene	ND		ug/l	0.50	0.16	1
cis-1,3-Dichloropropene	ND		ug/l	0.50	0.14	1
1,3-Dichloropropene, Total	ND		ug/l	0.50	0.14	1
1,1-Dichloropropene	ND		ug/l	2.5	0.70	1
Bromoform	ND		ug/l	2.0	0.65	1
1,1,2,2-Tetrachloroethane	ND		ug/l	0.50	0.17	1
Benzene	ND		ug/l	0.50	0.16	1
Toluene	ND		ug/l	2.5	0.70	1
Ethylbenzene	ND		ug/l	2.5	0.70	1
Chloromethane	ND		ug/l	2.5	0.70	1
Bromomethane	ND		ug/l	2.5	0.70	1
Vinyl chloride	ND		ug/l	1.0	0.07	1
Chloroethane	ND		ug/l	2.5	0.70	1
1,1-Dichloroethene	ND		ug/l	0.50	0.17	1
trans-1,2-Dichloroethene	ND		ug/l	2.5	0.70	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-01 Date Collected: 10/16/25 11:00

Client ID: P6TMW02_101625 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by GC/MS - Westborough Lab						
Trichloroethene	ND		ug/l	0.50	0.18	1
1,2-Dichlorobenzene	ND		ug/l	2.5	0.70	1
1,3-Dichlorobenzene	ND		ug/l	2.5	0.70	1
1,4-Dichlorobenzene	ND		ug/l	2.5	0.70	1
Methyl tert butyl ether	ND		ug/l	2.5	0.17	1
p/m-Xylene	ND		ug/l	2.5	0.70	1
o-Xylene	ND		ug/l	2.5	0.70	1
Xylenes, Total	ND		ug/l	2.5	0.70	1
cis-1,2-Dichloroethene	ND		ug/l	2.5	0.70	1
1,2-Dichloroethene, Total	ND		ug/l	2.5	0.70	1
Dibromomethane	ND		ug/l	5.0	1.0	1
1,2,3-Trichloropropane	ND		ug/l	2.5	0.70	1
Acrylonitrile	ND		ug/l	5.0	1.5	1
Styrene	ND		ug/l	2.5	0.70	1
Dichlorodifluoromethane	ND		ug/l	5.0	1.0	1
Acetone	2.9	J	ug/l	5.0	1.5	1
Carbon disulfide	ND		ug/l	5.0	1.0	1
2-Butanone	ND		ug/l	5.0	1.9	1
Vinyl acetate	ND		ug/l	5.0	1.0	1
4-Methyl-2-pentanone	ND		ug/l	5.0	1.0	1
2-Hexanone	ND		ug/l	5.0	1.0	1
Bromochloromethane	ND		ug/l	2.5	0.70	1
2,2-Dichloropropane	ND		ug/l	2.5	0.70	1
1,2-Dibromoethane	ND		ug/l	2.0	0.65	1
1,3-Dichloropropane	ND		ug/l	2.5	0.70	1
1,1,1,2-Tetrachloroethane	ND		ug/l	2.5	0.70	1
Bromobenzene	ND		ug/l	2.5	0.70	1
n-Butylbenzene	ND		ug/l	2.5	0.70	1
sec-Butylbenzene	ND		ug/l	2.5	0.70	1
tert-Butylbenzene	ND		ug/l	2.5	0.70	1
o-Chlorotoluene	ND		ug/l	2.5	0.70	1
p-Chlorotoluene	ND		ug/l	2.5	0.70	1
1,2-Dibromo-3-chloropropane	ND		ug/l	2.5	0.70	1
Hexachlorobutadiene	ND		ug/l	2.5	0.70	1
Isopropylbenzene	ND		ug/l	2.5	0.70	1
p-Isopropyltoluene	ND		ug/l	2.5	0.70	1
Naphthalene	ND		ug/l	2.5	0.70	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-01 Date Collected: 10/16/25 11:00

Client ID: P6TMW02_101625 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by GC/MS - Westborough Lab						
n-Propylbenzene	ND		ug/l	2.5	0.70	1
1,2,3-Trichlorobenzene	ND		ug/l	2.5	0.70	1
1,2,4-Trichlorobenzene	ND		ug/l	2.5	0.70	1
1,3,5-Trimethylbenzene	ND		ug/l	2.5	0.70	1
1,2,4-Trimethylbenzene	ND		ug/l	2.5	0.70	1
1,4-Dioxane	ND		ug/l	250	61.	1
p-Diethylbenzene	ND		ug/l	2.0	0.70	1
p-Ethyltoluene	ND		ug/l	2.0	0.70	1
1,2,4,5-Tetramethylbenzene	ND		ug/l	2.0	0.54	1
Ethyl ether	ND		ug/l	2.5	0.70	1
trans-1,4-Dichloro-2-butene	ND		ug/l	2.5	0.70	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	124		70-130
Toluene-d8	107		70-130
4-Bromofluorobenzene	107		70-130
Dibromofluoromethane	106		70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-02 Date Collected: 10/16/25 10:40
Client ID: P6TMW10_101625 Date Received: 10/16/25
Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:
Matrix: Water
Analytical Method: 1,8260D
Analytical Date: 10/23/25 09:22
Analyst: MJV

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by GC/MS - Westborough Lab						
Methylene chloride	ND		ug/l	2.5	0.70	1
1,1-Dichloroethane	ND		ug/l	2.5	0.70	1
Chloroform	ND		ug/l	2.5	0.70	1
Carbon tetrachloride	ND		ug/l	0.50	0.13	1
1,2-Dichloropropane	ND		ug/l	1.0	0.14	1
Dibromochloromethane	ND		ug/l	0.50	0.15	1
1,1,2-Trichloroethane	ND		ug/l	1.5	0.50	1
Tetrachloroethene	ND		ug/l	0.50	0.18	1
Chlorobenzene	ND		ug/l	2.5	0.70	1
Trichlorofluoromethane	ND		ug/l	2.5	0.70	1
1,2-Dichloroethane	ND		ug/l	0.50	0.13	1
1,1,1-Trichloroethane	ND		ug/l	2.5	0.70	1
Bromodichloromethane	ND		ug/l	0.50	0.19	1
trans-1,3-Dichloropropene	ND		ug/l	0.50	0.16	1
cis-1,3-Dichloropropene	ND		ug/l	0.50	0.14	1
1,3-Dichloropropene, Total	ND		ug/l	0.50	0.14	1
1,1-Dichloropropene	ND		ug/l	2.5	0.70	1
Bromoform	ND		ug/l	2.0	0.65	1
1,1,2,2-Tetrachloroethane	ND		ug/l	0.50	0.17	1
Benzene	ND		ug/l	0.50	0.16	1
Toluene	ND		ug/l	2.5	0.70	1
Ethylbenzene	ND		ug/l	2.5	0.70	1
Chloromethane	ND		ug/l	2.5	0.70	1
Bromomethane	ND		ug/l	2.5	0.70	1
Vinyl chloride	ND		ug/l	1.0	0.07	1
Chloroethane	ND		ug/l	2.5	0.70	1
1,1-Dichloroethene	ND		ug/l	0.50	0.17	1
trans-1,2-Dichloroethene	ND		ug/l	2.5	0.70	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-02 Date Collected: 10/16/25 10:40

Client ID: P6TMW10_101625 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by GC/MS - Westborough Lab						
Trichloroethene	ND		ug/l	0.50	0.18	1
1,2-Dichlorobenzene	ND		ug/l	2.5	0.70	1
1,3-Dichlorobenzene	ND		ug/l	2.5	0.70	1
1,4-Dichlorobenzene	ND		ug/l	2.5	0.70	1
Methyl tert butyl ether	ND		ug/l	2.5	0.17	1
p/m-Xylene	ND		ug/l	2.5	0.70	1
o-Xylene	ND		ug/l	2.5	0.70	1
Xylenes, Total	ND		ug/l	2.5	0.70	1
cis-1,2-Dichloroethene	ND		ug/l	2.5	0.70	1
1,2-Dichloroethene, Total	ND		ug/l	2.5	0.70	1
Dibromomethane	ND		ug/l	5.0	1.0	1
1,2,3-Trichloropropane	ND		ug/l	2.5	0.70	1
Acrylonitrile	ND		ug/l	5.0	1.5	1
Styrene	ND		ug/l	2.5	0.70	1
Dichlorodifluoromethane	ND		ug/l	5.0	1.0	1
Acetone	5.5		ug/l	5.0	1.5	1
Carbon disulfide	ND		ug/l	5.0	1.0	1
2-Butanone	ND		ug/l	5.0	1.9	1
Vinyl acetate	ND		ug/l	5.0	1.0	1
4-Methyl-2-pentanone	ND		ug/l	5.0	1.0	1
2-Hexanone	ND		ug/l	5.0	1.0	1
Bromochloromethane	ND		ug/l	2.5	0.70	1
2,2-Dichloropropane	ND		ug/l	2.5	0.70	1
1,2-Dibromoethane	ND		ug/l	2.0	0.65	1
1,3-Dichloropropane	ND		ug/l	2.5	0.70	1
1,1,1,2-Tetrachloroethane	ND		ug/l	2.5	0.70	1
Bromobenzene	ND		ug/l	2.5	0.70	1
n-Butylbenzene	ND		ug/l	2.5	0.70	1
sec-Butylbenzene	ND		ug/l	2.5	0.70	1
tert-Butylbenzene	ND		ug/l	2.5	0.70	1
o-Chlorotoluene	ND		ug/l	2.5	0.70	1
p-Chlorotoluene	ND		ug/l	2.5	0.70	1
1,2-Dibromo-3-chloropropane	ND		ug/l	2.5	0.70	1
Hexachlorobutadiene	ND		ug/l	2.5	0.70	1
Isopropylbenzene	ND		ug/l	2.5	0.70	1
p-Isopropyltoluene	ND		ug/l	2.5	0.70	1
Naphthalene	ND		ug/l	2.5	0.70	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-02 Date Collected: 10/16/25 10:40

Client ID: P6TMW10_101625 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by GC/MS - Westborough Lab						
n-Propylbenzene	ND		ug/l	2.5	0.70	1
1,2,3-Trichlorobenzene	ND		ug/l	2.5	0.70	1
1,2,4-Trichlorobenzene	ND		ug/l	2.5	0.70	1
1,3,5-Trimethylbenzene	ND		ug/l	2.5	0.70	1
1,2,4-Trimethylbenzene	ND		ug/l	2.5	0.70	1
1,4-Dioxane	ND		ug/l	250	61.	1
p-Diethylbenzene	ND		ug/l	2.0	0.70	1
p-Ethyltoluene	ND		ug/l	2.0	0.70	1
1,2,4,5-Tetramethylbenzene	ND		ug/l	2.0	0.54	1
Ethyl ether	ND		ug/l	2.5	0.70	1
trans-1,4-Dichloro-2-butene	ND		ug/l	2.5	0.70	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	124		70-130
Toluene-d8	106		70-130
4-Bromofluorobenzene	110		70-130
Dibromofluoromethane	104		70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-04 Date Collected: 10/16/25 15:20

Client ID: P6TMW09_101625 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Matrix: Water

Analytical Method: 1,8260D

Analytical Date: 10/23/25 10:09

Analyst: MJV

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by GC/MS - Westborough Lab						
Methylene chloride	ND		ug/l	2.5	0.70	1
1,1-Dichloroethane	ND		ug/l	2.5	0.70	1
Chloroform	ND		ug/l	2.5	0.70	1
Carbon tetrachloride	ND		ug/l	0.50	0.13	1
1,2-Dichloropropane	ND		ug/l	1.0	0.14	1
Dibromochloromethane	ND		ug/l	0.50	0.15	1
1,1,2-Trichloroethane	ND		ug/l	1.5	0.50	1
Tetrachloroethene	ND		ug/l	0.50	0.18	1
Chlorobenzene	ND		ug/l	2.5	0.70	1
Trichlorofluoromethane	ND		ug/l	2.5	0.70	1
1,2-Dichloroethane	ND		ug/l	0.50	0.13	1
1,1,1-Trichloroethane	ND		ug/l	2.5	0.70	1
Bromodichloromethane	ND		ug/l	0.50	0.19	1
trans-1,3-Dichloropropene	ND		ug/l	0.50	0.16	1
cis-1,3-Dichloropropene	ND		ug/l	0.50	0.14	1
1,3-Dichloropropene, Total	ND		ug/l	0.50	0.14	1
1,1-Dichloropropene	ND		ug/l	2.5	0.70	1
Bromoform	ND		ug/l	2.0	0.65	1
1,1,2,2-Tetrachloroethane	ND		ug/l	0.50	0.17	1
Benzene	ND		ug/l	0.50	0.16	1
Toluene	ND		ug/l	2.5	0.70	1
Ethylbenzene	ND		ug/l	2.5	0.70	1
Chloromethane	ND		ug/l	2.5	0.70	1
Bromomethane	ND		ug/l	2.5	0.70	1
Vinyl chloride	ND		ug/l	1.0	0.07	1
Chloroethane	ND		ug/l	2.5	0.70	1
1,1-Dichloroethene	ND		ug/l	0.50	0.17	1
trans-1,2-Dichloroethene	ND		ug/l	2.5	0.70	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-04 Date Collected: 10/16/25 15:20

Client ID: P6TMW09_101625 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by GC/MS - Westborough Lab						
Trichloroethene	ND		ug/l	0.50	0.18	1
1,2-Dichlorobenzene	ND		ug/l	2.5	0.70	1
1,3-Dichlorobenzene	ND		ug/l	2.5	0.70	1
1,4-Dichlorobenzene	ND		ug/l	2.5	0.70	1
Methyl tert butyl ether	ND		ug/l	2.5	0.17	1
p/m-Xylene	ND		ug/l	2.5	0.70	1
o-Xylene	ND		ug/l	2.5	0.70	1
Xylenes, Total	ND		ug/l	2.5	0.70	1
cis-1,2-Dichloroethene	ND		ug/l	2.5	0.70	1
1,2-Dichloroethene, Total	ND		ug/l	2.5	0.70	1
Dibromomethane	ND		ug/l	5.0	1.0	1
1,2,3-Trichloropropane	ND		ug/l	2.5	0.70	1
Acrylonitrile	ND		ug/l	5.0	1.5	1
Styrene	ND		ug/l	2.5	0.70	1
Dichlorodifluoromethane	ND		ug/l	5.0	1.0	1
Acetone	5.0		ug/l	5.0	1.5	1
Carbon disulfide	ND		ug/l	5.0	1.0	1
2-Butanone	ND		ug/l	5.0	1.9	1
Vinyl acetate	ND		ug/l	5.0	1.0	1
4-Methyl-2-pentanone	ND		ug/l	5.0	1.0	1
2-Hexanone	ND		ug/l	5.0	1.0	1
Bromochloromethane	ND		ug/l	2.5	0.70	1
2,2-Dichloropropane	ND		ug/l	2.5	0.70	1
1,2-Dibromoethane	ND		ug/l	2.0	0.65	1
1,3-Dichloropropane	ND		ug/l	2.5	0.70	1
1,1,1,2-Tetrachloroethane	ND		ug/l	2.5	0.70	1
Bromobenzene	ND		ug/l	2.5	0.70	1
n-Butylbenzene	ND		ug/l	2.5	0.70	1
sec-Butylbenzene	ND		ug/l	2.5	0.70	1
tert-Butylbenzene	ND		ug/l	2.5	0.70	1
o-Chlorotoluene	ND		ug/l	2.5	0.70	1
p-Chlorotoluene	ND		ug/l	2.5	0.70	1
1,2-Dibromo-3-chloropropane	ND		ug/l	2.5	0.70	1
Hexachlorobutadiene	ND		ug/l	2.5	0.70	1
Isopropylbenzene	ND		ug/l	2.5	0.70	1
p-Isopropyltoluene	ND		ug/l	2.5	0.70	1
Naphthalene	ND		ug/l	2.5	0.70	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-04 Date Collected: 10/16/25 15:20

Client ID: P6TMW09_101625 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Not Specified

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Volatile Organics by GC/MS - Westborough Lab						
n-Propylbenzene	ND		ug/l	2.5	0.70	1
1,2,3-Trichlorobenzene	ND		ug/l	2.5	0.70	1
1,2,4-Trichlorobenzene	ND		ug/l	2.5	0.70	1
1,3,5-Trimethylbenzene	ND		ug/l	2.5	0.70	1
1,2,4-Trimethylbenzene	ND		ug/l	2.5	0.70	1
1,4-Dioxane	ND		ug/l	250	61.	1
p-Diethylbenzene	ND		ug/l	2.0	0.70	1
p-Ethyltoluene	ND		ug/l	2.0	0.70	1
1,2,4,5-Tetramethylbenzene	ND		ug/l	2.0	0.54	1
Ethyl ether	ND		ug/l	2.5	0.70	1
trans-1,4-Dichloro-2-butene	ND		ug/l	2.5	0.70	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	127		70-130
Toluene-d8	106		70-130
4-Bromofluorobenzene	108		70-130
Dibromofluoromethane	107		70-130

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/23/25 07:24
Analyst: MCM

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by GC/MS - Westborough Lab for sample(s): 01-02,04 Batch: WG2131834-5					
Methylene chloride	ND		ug/l	2.5	0.70
1,1-Dichloroethane	ND		ug/l	2.5	0.70
Chloroform	ND		ug/l	2.5	0.70
Carbon tetrachloride	ND		ug/l	0.50	0.13
1,2-Dichloropropane	ND		ug/l	1.0	0.14
Dibromochloromethane	ND		ug/l	0.50	0.15
1,1,2-Trichloroethane	ND		ug/l	1.5	0.50
Tetrachloroethene	ND		ug/l	0.50	0.18
Chlorobenzene	ND		ug/l	2.5	0.70
Trichlorofluoromethane	ND		ug/l	2.5	0.70
1,2-Dichloroethane	ND		ug/l	0.50	0.13
1,1,1-Trichloroethane	ND		ug/l	2.5	0.70
Bromodichloromethane	ND		ug/l	0.50	0.19
trans-1,3-Dichloropropene	ND		ug/l	0.50	0.16
cis-1,3-Dichloropropene	ND		ug/l	0.50	0.14
1,3-Dichloropropene, Total	ND		ug/l	0.50	0.14
1,1-Dichloropropene	ND		ug/l	2.5	0.70
Bromoform	ND		ug/l	2.0	0.65
1,1,2,2-Tetrachloroethane	ND		ug/l	0.50	0.17
Benzene	ND		ug/l	0.50	0.16
Toluene	ND		ug/l	2.5	0.70
Ethylbenzene	ND		ug/l	2.5	0.70
Chloromethane	ND		ug/l	2.5	0.70
Bromomethane	ND		ug/l	2.5	0.70

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/23/25 07:24
Analyst: MCM

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by GC/MS - Westborough Lab for sample(s): 01-02,04 Batch: WG2131834-5					
Vinyl chloride	ND		ug/l	1.0	0.07
Chloroethane	ND		ug/l	2.5	0.70
1,1-Dichloroethene	ND		ug/l	0.50	0.17
trans-1,2-Dichloroethene	ND		ug/l	2.5	0.70
Trichloroethene	ND		ug/l	0.50	0.18
1,2-Dichlorobenzene	ND		ug/l	2.5	0.70
1,3-Dichlorobenzene	ND		ug/l	2.5	0.70
1,4-Dichlorobenzene	ND		ug/l	2.5	0.70
Methyl tert butyl ether	ND		ug/l	2.5	0.17
p/m-Xylene	ND		ug/l	2.5	0.70
o-Xylene	ND		ug/l	2.5	0.70
Xylenes, Total	ND		ug/l	2.5	0.70
cis-1,2-Dichloroethene	ND		ug/l	2.5	0.70
1,2-Dichloroethene, Total	ND		ug/l	2.5	0.70
Dibromomethane	ND		ug/l	5.0	1.0
1,2,3-Trichloropropane	ND		ug/l	2.5	0.70
Acrylonitrile	ND		ug/l	5.0	1.5
Styrene	ND		ug/l	2.5	0.70
Dichlorodifluoromethane	ND		ug/l	5.0	1.0
Acetone	ND		ug/l	5.0	1.5
Carbon disulfide	ND		ug/l	5.0	1.0
2-Butanone	ND		ug/l	5.0	1.9
Vinyl acetate	ND		ug/l	5.0	1.0
4-Methyl-2-pentanone	ND		ug/l	5.0	1.0

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/23/25 07:24
Analyst: MCM

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by GC/MS - Westborough Lab for sample(s): 01-02,04 Batch: WG2131834-5					
2-Hexanone	ND		ug/l	5.0	1.0
Bromochloromethane	ND		ug/l	2.5	0.70
2,2-Dichloropropane	ND		ug/l	2.5	0.70
1,2-Dibromoethane	ND		ug/l	2.0	0.65
1,3-Dichloropropane	ND		ug/l	2.5	0.70
1,1,1,2-Tetrachloroethane	ND		ug/l	2.5	0.70
Bromobenzene	ND		ug/l	2.5	0.70
n-Butylbenzene	ND		ug/l	2.5	0.70
sec-Butylbenzene	ND		ug/l	2.5	0.70
tert-Butylbenzene	ND		ug/l	2.5	0.70
o-Chlorotoluene	ND		ug/l	2.5	0.70
p-Chlorotoluene	ND		ug/l	2.5	0.70
1,2-Dibromo-3-chloropropane	ND		ug/l	2.5	0.70
Hexachlorobutadiene	ND		ug/l	2.5	0.70
Isopropylbenzene	ND		ug/l	2.5	0.70
p-Isopropyltoluene	ND		ug/l	2.5	0.70
Naphthalene	ND		ug/l	2.5	0.70
n-Propylbenzene	ND		ug/l	2.5	0.70
1,2,3-Trichlorobenzene	ND		ug/l	2.5	0.70
1,2,4-Trichlorobenzene	ND		ug/l	2.5	0.70
1,3,5-Trimethylbenzene	ND		ug/l	2.5	0.70
1,2,4-Trimethylbenzene	ND		ug/l	2.5	0.70
1,4-Dioxane	ND		ug/l	250	61.
p-Diethylbenzene	ND		ug/l	2.0	0.70

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8260D
Analytical Date: 10/23/25 07:24
Analyst: MCM

Parameter	Result	Qualifier	Units	RL	MDL
Volatile Organics by GC/MS - Westborough Lab for sample(s): 01-02,04 Batch: WG2131834-5					
p-Ethyltoluene	ND		ug/l	2.0	0.70
1,2,4,5-Tetramethylbenzene	ND		ug/l	2.0	0.54
Ethyl ether	ND		ug/l	2.5	0.70
trans-1,4-Dichloro-2-butene	ND		ug/l	2.5	0.70

Surrogate	%Recovery	Qualifier	Acceptance Criteria
1,2-Dichloroethane-d4	121		70-130
Toluene-d8	108		70-130
4-Bromofluorobenzene	110		70-130
Dibromofluoromethane	109		70-130

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-02,04 Batch: WG2131834-3 WG2131834-4								
Methylene chloride	100		100		70-130	0		20
1,1-Dichloroethane	110		110		70-130	0		20
Chloroform	96		100		70-130	4		20
Carbon tetrachloride	91		95		63-132	4		20
1,2-Dichloropropane	99		100		70-130	1		20
Dibromochloromethane	90		87		63-130	3		20
1,1,2-Trichloroethane	99		96		70-130	3		20
Tetrachloroethene	93		92		70-130	1		20
Chlorobenzene	97		94		75-130	3		20
Trichlorofluoromethane	100		100		62-150	0		20
1,2-Dichloroethane	100		110		70-130	10		20
1,1,1-Trichloroethane	100		100		67-130	0		20
Bromodichloromethane	100		100		67-130	0		20
trans-1,3-Dichloropropene	94		91		70-130	3		20
cis-1,3-Dichloropropene	88		99		70-130	12		20
1,1-Dichloropropene	96		100		70-130	4		20
Bromoform	77		78		54-136	1		20
1,1,2,2-Tetrachloroethane	110		100		67-130	10		20
Benzene	100		100		70-130	0		20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-02,04 Batch: WG2131834-3 WG2131834-4								
Toluene	100		97		70-130	3		20
Ethylbenzene	98		95		70-130	3		20
Chloromethane	110		120		64-130	9		20
Bromomethane	72		74		39-139	3		20
Vinyl chloride	110		110		55-140	0		20
Chloroethane	100		100		55-138	0		20
1,1-Dichloroethene	98		99		61-145	1		20
trans-1,2-Dichloroethene	94		98		70-130	4		20
Trichloroethene	94		96		70-130	2		20
1,2-Dichlorobenzene	94		93		70-130	1		20
1,3-Dichlorobenzene	96		96		70-130	0		20
1,4-Dichlorobenzene	95		110		70-130	15		20
Methyl tert butyl ether	81		86		63-130	6		20
p/m-Xylene	95		90		70-130	5		20
o-Xylene	90		90		70-130	0		20
cis-1,2-Dichloroethene	96		98		70-130	2		20
Dibromomethane	100		110		70-130	10		20
1,2,3-Trichloropropane	110		110		64-130	0		20
Acrylonitrile	100		110		70-130	10		20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-02,04 Batch: WG2131834-3 WG2131834-4								
Styrene	95		90		70-130	5		20
Dichlorodifluoromethane	87		88		36-147	1		20
Acetone	120		120		58-148	0		20
Carbon disulfide	100		110		51-130	10		20
2-Butanone	100		100		63-138	0		20
Vinyl acetate	100		100		70-130	0		20
4-Methyl-2-pentanone	86		77		59-130	11		20
2-Hexanone	96		90		57-130	6		20
Bromochloromethane	94		93		70-130	1		20
2,2-Dichloropropane	88		88		63-133	0		20
1,2-Dibromoethane	94		92		70-130	2		20
1,3-Dichloropropane	110		100		70-130	10		20
1,1,1,2-Tetrachloroethane	90		89		64-130	1		20
Bromobenzene	91		93		70-130	2		20
n-Butylbenzene	100		110		53-136	10		20
sec-Butylbenzene	100		100		70-130	0		20
tert-Butylbenzene	96		98		70-130	2		20
o-Chlorotoluene	100		110		70-130	10		20
p-Chlorotoluene	100		110		70-130	10		20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-02,04 Batch: WG2131834-3 WG2131834-4								
1,2-Dibromo-3-chloropropane	84		85		41-144	1		20
Hexachlorobutadiene	86		90		63-130	5		20
Isopropylbenzene	99		100		70-130	1		20
p-Isopropyltoluene	89		100		70-130	12		20
Naphthalene	84		87		70-130	4		20
n-Propylbenzene	100		100		69-130	0		20
1,2,3-Trichlorobenzene	86		90		70-130	5		20
1,2,4-Trichlorobenzene	82		87		70-130	6		20
1,3,5-Trimethylbenzene	100		100		64-130	0		20
1,2,4-Trimethylbenzene	100		100		70-130	0		20
1,4-Dioxane	148		120		56-162	**21**	Q	20
p-Diethylbenzene	91		95		70-130	4		20
p-Ethyltoluene	100		100		70-130	0		20
1,2,4,5-Tetramethylbenzene	96		98		70-130	2		20
Ethyl ether	91		95		59-134	4		20
trans-1,4-Dichloro-2-butene	100		98		70-130	2		20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics by GC/MS - Westborough Lab Associated sample(s): 01-02,04 Batch: WG2131834-3 WG2131834-4								

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria
1,2-Dichloroethane-d4	117		116		70-130
Toluene-d8	109		105		70-130
4-Bromofluorobenzene	108		107		70-130
Dibromofluoromethane	102		102		70-130

SEMIVOLATILES

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-01
Client ID: P6TMW02_101625
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 11:00
Date Received: 10/16/25
Field Prep: Refer to COC

Sample Depth:
Matrix: Water
Analytical Method: 1,8270E
Analytical Date: 10/23/25 00:42
Analyst: CMM

Extraction Method: EPA 3510C
Extraction Date: 10/22/25 01:11

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
1,2,4-Trichlorobenzene	ND		ug/l	5.0	0.98	1
Bis(2-chloroethyl)ether	ND		ug/l	2.0	0.39	1
1,2-Dichlorobenzene	ND		ug/l	2.0	0.33	1
1,3-Dichlorobenzene	ND		ug/l	2.0	0.32	1
1,4-Dichlorobenzene	ND		ug/l	2.0	0.39	1
3,3'-Dichlorobenzidine	ND		ug/l	5.0	1.8	1
2,4-Dinitrotoluene	ND		ug/l	5.0	0.54	1
2,6-Dinitrotoluene	ND		ug/l	5.0	0.84	1
4-Chlorophenyl phenyl ether	ND		ug/l	2.0	0.39	1
4-Bromophenyl phenyl ether	ND		ug/l	2.0	0.24	1
Bis(2-chloroisopropyl)ether	ND		ug/l	2.0	0.40	1
Bis(2-chloroethoxy)methane	ND		ug/l	5.0	0.84	1
Hexachlorocyclopentadiene	ND		ug/l	20	1.2	1
Isophorone	ND		ug/l	5.0	0.86	1
Nitrobenzene	ND		ug/l	2.0	0.20	1
NDPA/DPA	ND		ug/l	2.0	0.92	1
n-Nitrosodi-n-propylamine	ND		ug/l	5.0	0.91	1
Bis(2-ethylhexyl)phthalate	ND		ug/l	3.0	1.4	1
Butyl benzyl phthalate	ND		ug/l	5.0	2.6	1
Di-n-butylphthalate	ND		ug/l	5.0	0.96	1
Di-n-octylphthalate	ND		ug/l	5.0	2.3	1
Diethyl phthalate	ND		ug/l	5.0	0.76	1
Dimethyl phthalate	ND		ug/l	5.0	0.92	1
Biphenyl	ND		ug/l	2.0	0.20	1
4-Chloroaniline	ND		ug/l	5.0	0.47	1
2-Nitroaniline	ND		ug/l	5.0	1.0	1
3-Nitroaniline	ND		ug/l	5.0	1.2	1
4-Nitroaniline	ND		ug/l	5.0	1.4	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-01 Date Collected: 10/16/25 11:00

Client ID: P6TMW02_101625 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS - Westborough Lab						
Dibenzofuran	ND		ug/l	2.0	0.40	1
1,2,4,5-Tetrachlorobenzene	ND		ug/l	10	0.24	1
Acetophenone	ND		ug/l	5.0	0.92	1
2,4,6-Trichlorophenol	ND		ug/l	5.0	2.1	1
p-Chloro-m-cresol	ND		ug/l	2.0	0.61	1
2-Chlorophenol	ND		ug/l	2.0	0.65	1
2,4-Dichlorophenol	ND		ug/l	5.0	1.7	1
2,4-Dimethylphenol	ND		ug/l	5.0	2.0	1
2-Nitrophenol	ND		ug/l	10	2.0	1
4-Nitrophenol	ND		ug/l	10	1.4	1
2,4-Dinitrophenol	ND		ug/l	20	5.4	1
4,6-Dinitro-o-cresol	ND		ug/l	10	2.3	1
Phenol	ND		ug/l	5.0	0.35	1
2-Methylphenol	ND		ug/l	5.0	2.3	1
3-Methylphenol/4-Methylphenol	ND		ug/l	5.0	1.4	1
2,4,5-Trichlorophenol	ND		ug/l	5.0	2.1	1
Benzoic Acid	8.5	J	ug/l	50	2.6	1
Benzyl Alcohol	ND		ug/l	2.0	0.38	1
Carbazole	ND		ug/l	2.0	0.31	1

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	56		21-120
Phenol-d6	47		10-120
Nitrobenzene-d5	80		23-120
2-Fluorobiphenyl	70		15-120
2,4,6-Tribromophenol	85		10-120
4-Terphenyl-d14	68		41-149

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-01
Client ID: P6TMW02_101625
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 11:00
Date Received: 10/16/25
Field Prep: Refer to COC

Sample Depth:
Matrix: Water
Analytical Method: 1,8270E-SIM
Analytical Date: 10/23/25 16:19
Analyst: JJW

Extraction Method: EPA 3510C
Extraction Date: 10/22/25 01:11

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS-SIM - Westborough Lab						
Acenaphthene	0.05	J	ug/l	0.10	0.02	1
2-Chloronaphthalene	ND		ug/l	0.20	0.02	1
Fluoranthene	0.59		ug/l	0.10	0.03	1
Hexachlorobutadiene	ND		ug/l	0.50	0.02	1
Naphthalene	0.03	J	ug/l	0.10	0.02	1
Benzo(a)anthracene	0.24		ug/l	0.10	0.03	1
Benzo(a)pyrene	0.20		ug/l	0.10	0.02	1
Benzo(b)fluoranthene	0.25		ug/l	0.10	0.03	1
Benzo(k)fluoranthene	0.09	J	ug/l	0.10	0.03	1
Chrysene	0.19		ug/l	0.10	0.03	1
Acenaphthylene	0.04	J	ug/l	0.10	0.02	1
Anthracene	0.12		ug/l	0.10	0.02	1
Benzo(ghi)perylene	0.09	J	ug/l	0.10	0.02	1
Fluorene	0.05	J	ug/l	0.10	0.03	1
Phenanthrene	0.34		ug/l	0.10	0.04	1
Dibenzo(a,h)anthracene	ND		ug/l	0.10	0.02	1
Indeno(1,2,3-cd)pyrene	0.10	J	ug/l	0.10	0.02	1
Pyrene	0.47		ug/l	0.10	0.04	1
2-Methylnaphthalene	0.05	J	ug/l	0.10	0.03	1
Pentachlorophenol	0.08	J	ug/l	0.80	0.06	1
Hexachlorobenzene	ND		ug/l	0.80	0.01	1
Hexachloroethane	ND		ug/l	0.80	0.02	1

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-01 Date Collected: 10/16/25 11:00

Client ID: P6TMW02_101625 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor
Semivolatile Organics by GC/MS-SIM - Westborough Lab						

Surrogate	% Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	65		21-120
Phenol-d6	53		10-120
Nitrobenzene-d5	81		23-120
2-Fluorobiphenyl	73		15-120
2,4,6-Tribromophenol	96		10-120
4-Terphenyl-d14	80		41-149

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/22/25 20:24
Analyst: CMM

Extraction Method: EPA 3510C
Extraction Date: 10/22/25 01:11

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01 Batch: WG2130937-1					
Acenaphthene	ND		ug/l	2.0	0.40
1,2,4-Trichlorobenzene	ND		ug/l	5.0	0.98
Hexachlorobenzene	ND		ug/l	2.0	0.45
Bis(2-chloroethyl)ether	ND		ug/l	2.0	0.39
2-Chloronaphthalene	ND		ug/l	2.0	0.35
1,2-Dichlorobenzene	ND		ug/l	2.0	0.33
1,3-Dichlorobenzene	ND		ug/l	2.0	0.32
1,4-Dichlorobenzene	ND		ug/l	2.0	0.39
3,3'-Dichlorobenzidine	ND		ug/l	5.0	1.8
2,4-Dinitrotoluene	ND		ug/l	5.0	0.54
2,6-Dinitrotoluene	ND		ug/l	5.0	0.84
Fluoranthene	ND		ug/l	2.0	0.41
4-Chlorophenyl phenyl ether	ND		ug/l	2.0	0.39
4-Bromophenyl phenyl ether	ND		ug/l	2.0	0.24
Bis(2-chloroisopropyl)ether	ND		ug/l	2.0	0.40
Bis(2-chloroethoxy)methane	ND		ug/l	5.0	0.84
Hexachlorobutadiene	ND		ug/l	2.0	0.36
Hexachlorocyclopentadiene	ND		ug/l	20	1.2
Hexachloroethane	ND		ug/l	2.0	0.20
Isophorone	ND		ug/l	5.0	0.86
Naphthalene	ND		ug/l	2.0	0.54
Nitrobenzene	ND		ug/l	2.0	0.20
NDPA/DPA	ND		ug/l	2.0	0.92
n-Nitrosodi-n-propylamine	ND		ug/l	5.0	0.91

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/22/25 20:24
Analyst: CMM

Extraction Method: EPA 3510C
Extraction Date: 10/22/25 01:11

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01 Batch: WG2130937-1					
Bis(2-ethylhexyl)phthalate	ND		ug/l	3.0	1.4
Butyl benzyl phthalate	ND		ug/l	5.0	2.6
Di-n-butylphthalate	ND		ug/l	5.0	0.96
Di-n-octylphthalate	ND		ug/l	5.0	2.3
Diethyl phthalate	ND		ug/l	5.0	0.76
Dimethyl phthalate	ND		ug/l	5.0	0.92
Benzo(a)anthracene	ND		ug/l	2.0	0.32
Benzo(a)pyrene	ND		ug/l	2.0	0.37
Benzo(b)fluoranthene	ND		ug/l	2.0	0.53
Benzo(k)fluoranthene	ND		ug/l	2.0	0.62
Chrysene	ND		ug/l	2.0	0.22
Acenaphthylene	ND		ug/l	2.0	0.32
Anthracene	ND		ug/l	2.0	0.47
Benzo(ghi)perylene	ND		ug/l	2.0	0.37
Fluorene	ND		ug/l	2.0	0.44
Phenanthrene	ND		ug/l	2.0	0.42
Dibenzo(a,h)anthracene	ND		ug/l	2.0	0.29
Indeno(1,2,3-cd)pyrene	ND		ug/l	2.0	0.48
Pyrene	ND		ug/l	2.0	0.41
Biphenyl	ND		ug/l	2.0	0.20
4-Chloroaniline	ND		ug/l	5.0	0.47
2-Nitroaniline	ND		ug/l	5.0	1.0
3-Nitroaniline	ND		ug/l	5.0	1.2
4-Nitroaniline	ND		ug/l	5.0	1.4

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/22/25 20:24
Analyst: CMM

Extraction Method: EPA 3510C
Extraction Date: 10/22/25 01:11

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01 Batch: WG2130937-1					
Dibenzofuran	ND		ug/l	2.0	0.40
2-Methylnaphthalene	ND		ug/l	2.0	0.37
1,2,4,5-Tetrachlorobenzene	ND		ug/l	10	0.24
Acetophenone	ND		ug/l	5.0	0.92
2,4,6-Trichlorophenol	ND		ug/l	5.0	2.1
p-Chloro-m-cresol	ND		ug/l	2.0	0.61
2-Chlorophenol	ND		ug/l	2.0	0.65
2,4-Dichlorophenol	ND		ug/l	5.0	1.7
2,4-Dimethylphenol	ND		ug/l	5.0	2.0
2-Nitrophenol	ND		ug/l	10	2.0
4-Nitrophenol	ND		ug/l	10	1.4
2,4-Dinitrophenol	ND		ug/l	20	5.4
4,6-Dinitro-o-cresol	ND		ug/l	10	2.3
Pentachlorophenol	ND		ug/l	10	2.5
Phenol	ND		ug/l	5.0	0.35
2-Methylphenol	ND		ug/l	5.0	2.3
3-Methylphenol/4-Methylphenol	ND		ug/l	5.0	1.4
2,4,5-Trichlorophenol	ND		ug/l	5.0	2.1
Benzoic Acid	ND		ug/l	50	2.6
Benzyl Alcohol	ND		ug/l	2.0	0.38
Carbazole	ND		ug/l	2.0	0.31

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E
Analytical Date: 10/22/25 20:24
Analyst: CMM

Extraction Method: EPA 3510C
Extraction Date: 10/22/25 01:11

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS - Westborough Lab for sample(s): 01 Batch: WG2130937-1					

Surrogate	%Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	65		21-120
Phenol-d6	49		10-120
Nitrobenzene-d5	93		23-120
2-Fluorobiphenyl	79		15-120
2,4,6-Tribromophenol	87		10-120
4-Terphenyl-d14	80		41-149

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E-SIM
Analytical Date: 10/23/25 16:02
Analyst: JJW

Extraction Method: EPA 3510C
Extraction Date: 10/22/25 01:11

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS-SIM - Westborough Lab for sample(s): 01 Batch: WG2130939-1					
Acenaphthene	ND		ug/l	0.10	0.02
2-Chloronaphthalene	ND		ug/l	0.20	0.02
Fluoranthene	ND		ug/l	0.10	0.03
Hexachlorobutadiene	ND		ug/l	0.50	0.02
Naphthalene	ND		ug/l	0.10	0.02
Benzo(a)anthracene	ND		ug/l	0.10	0.03
Benzo(a)pyrene	ND		ug/l	0.10	0.02
Benzo(b)fluoranthene	ND		ug/l	0.10	0.03
Benzo(k)fluoranthene	ND		ug/l	0.10	0.03
Chrysene	ND		ug/l	0.10	0.03
Acenaphthylene	ND		ug/l	0.10	0.02
Anthracene	ND		ug/l	0.10	0.02
Benzo(ghi)perylene	ND		ug/l	0.10	0.02
Fluorene	ND		ug/l	0.10	0.03
Phenanthrene	ND		ug/l	0.10	0.04
Dibenzo(a,h)anthracene	ND		ug/l	0.10	0.02
Indeno(1,2,3-cd)pyrene	ND		ug/l	0.10	0.02
Pyrene	ND		ug/l	0.10	0.04
2-Methylnaphthalene	ND		ug/l	0.10	0.03
Pentachlorophenol	ND		ug/l	0.80	0.06
Hexachlorobenzene	ND		ug/l	0.80	0.01
Hexachloroethane	ND		ug/l	0.80	0.02

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8270E-SIM
Analytical Date: 10/23/25 16:02
Analyst: JJW

Extraction Method: EPA 3510C
Extraction Date: 10/22/25 01:11

Parameter	Result	Qualifier	Units	RL	MDL
Semivolatile Organics by GC/MS-SIM - Westborough Lab for sample(s): 01 Batch: WG2130939-1					

Surrogate	%Recovery	Qualifier	Acceptance Criteria
2-Fluorophenol	72		21-120
Phenol-d6	56		10-120
Nitrobenzene-d5	92		23-120
2-Fluorobiphenyl	78		15-120
2,4,6-Tribromophenol	94		10-120
4-Terphenyl-d14	87		41-149

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2130937-2 WG2130937-3								
Acenaphthene	74		80		37-111	8		30
1,2,4-Trichlorobenzene	56		65		39-98	15		30
Hexachlorobenzene	82		86		40-140	5		30
Bis(2-chloroethyl)ether	69		77		40-140	11		30
2-Chloronaphthalene	67		74		40-140	10		30
1,2-Dichlorobenzene	54		61		40-140	12		30
1,3-Dichlorobenzene	53		58		40-140	9		30
1,4-Dichlorobenzene	54		61		36-97	12		30
3,3'-Dichlorobenzidine	92		101		40-140	9		30
2,4-Dinitrotoluene	91		99		48-143	8		30
2,6-Dinitrotoluene	84		87		40-140	4		30
Fluoranthene	83		88		40-140	6		30
4-Chlorophenyl phenyl ether	77		86		40-140	11		30
4-Bromophenyl phenyl ether	81		85		40-140	5		30
Bis(2-chloroisopropyl)ether	57		65		40-140	13		30
Bis(2-chloroethoxy)methane	74		81		40-140	9		30
Hexachlorobutadiene	59		67		40-140	13		30
Hexachlorocyclopentadiene	54		65		40-140	18		30
Hexachloroethane	58		67		40-140	14		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2130937-2 WG2130937-3								
Isophorone	81		94		40-140	15		30
Naphthalene	61		67		40-140	9		30
Nitrobenzene	78		87		40-140	11		30
NDPA/DPA	80		89		40-140	11		30
n-Nitrosodi-n-propylamine	87		98		29-132	12		30
Bis(2-ethylhexyl)phthalate	101		108		40-140	7		30
Butyl benzyl phthalate	94		98		40-140	4		30
Di-n-butylphthalate	90		97		40-140	7		30
Di-n-octylphthalate	100		106		40-140	6		30
Diethyl phthalate	85		92		40-140	8		30
Dimethyl phthalate	80		86		40-140	7		30
Benzo(a)anthracene	89		94		40-140	5		30
Benzo(a)pyrene	92		96		40-140	4		30
Benzo(b)fluoranthene	91		98		40-140	7		30
Benzo(k)fluoranthene	86		89		40-140	3		30
Chrysene	87		92		40-140	6		30
Acenaphthylene	73		81		45-123	10		30
Anthracene	80		83		40-140	4		30
Benzo(ghi)perylene	84		87		40-140	4		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2130937-2 WG2130937-3								
Fluorene	79		85		40-140	7		30
Phenanthrene	79		81		40-140	3		30
Dibenzo(a,h)anthracene	84		88		40-140	5		30
Indeno(1,2,3-cd)pyrene	89		93		40-140	4		30
Pyrene	82		84		26-127	2		30
Biphenyl	65		74		40-140	13		30
4-Chloroaniline	69		72		40-140	4		30
2-Nitroaniline	84		89		52-143	6		30
3-Nitroaniline	83		84		25-145	1		30
4-Nitroaniline	87		94		51-143	8		30
Dibenzofuran	75		82		40-140	9		30
2-Methylnaphthalene	65		71		40-140	9		30
1,2,4,5-Tetrachlorobenzene	68		72		2-134	6		30
Acetophenone	70		80		39-129	13		30
2,4,6-Trichlorophenol	87		97		30-130	11		30
p-Chloro-m-cresol	88		92		23-97	4		30
2-Chlorophenol	64		72		27-123	12		30
2,4-Dichlorophenol	74		81		30-130	9		30
2,4-Dimethylphenol	57		75		30-130	27		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2130937-2 WG2130937-3								
2-Nitrophenol	70		81		30-130	15		30
4-Nitrophenol	**88**	Q	**94**	Q	10-80	7		30
2,4-Dinitrophenol	73		89		20-130	20		30
4,6-Dinitro-o-cresol	87		98		20-164	12		30
Pentachlorophenol	88		101		9-103	14		30
Phenol	47		52		12-110	10		30
2-Methylphenol	67		81		30-130	19		30
3-Methylphenol/4-Methylphenol	69		80		30-130	15		30
2,4,5-Trichlorophenol	89		99		30-130	11		30
Benzoic Acid	75		87		10-164	15		30
Benzyl Alcohol	79		89		26-116	12		30
Carbazole	81		87		55-144	7		30

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS - Westborough Lab Associated sample(s): 01 Batch: WG2130937-2 WG2130937-3								

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria
2-Fluorophenol	55		59		21-120
Phenol-d6	45		51		10-120
Nitrobenzene-d5	73		89		23-120
2-Fluorobiphenyl	66		70		15-120
2,4,6-Tribromophenol	86		89		10-120
4-Terphenyl-d14	73		78		41-149

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS-SIM - Westborough Lab	Associated sample(s): 01		Batch: WG2130939-2 WG2130939-3					
Acenaphthene	79		85		40-140	7		40
2-Chloronaphthalene	69		75		40-140	8		40
Fluoranthene	88		92		40-140	4		40
Hexachlorobutadiene	50		57		40-140	13		40
Naphthalene	65		71		40-140	9		40
Benzo(a)anthracene	92		95		40-140	3		40
Benzo(a)pyrene	99		104		40-140	5		40
Benzo(b)fluoranthene	92		102		40-140	10		40
Benzo(k)fluoranthene	98		97		40-140	1		40
Chrysene	99		105		40-140	6		40
Acenaphthylene	79		84		40-140	6		40
Anthracene	90		94		40-140	4		40
Benzo(ghi)perylene	90		94		40-140	4		40
Fluorene	86		91		40-140	6		40
Phenanthrene	86		90		40-140	5		40
Dibenzo(a,h)anthracene	94		98		40-140	4		40
Indeno(1,2,3-cd)pyrene	99		105		40-140	6		40
Pyrene	88		91		40-140	3		40
2-Methylnaphthalene	71		77		40-140	8		40

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Semivolatile Organics by GC/MS-SIM - Westborough Lab Associated sample(s): 01 Batch: WG2130939-2 WG2130939-3								
Pentachlorophenol	112		116		40-140	4		40
Hexachlorobenzene	92		95		40-140	3		40
Hexachloroethane	56		63		40-140	12		40

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria
2-Fluorophenol	63		67		21-120
Phenol-d6	52		56		10-120
Nitrobenzene-d5	77		84		23-120
2-Fluorobiphenyl	67		71		15-120
2,4,6-Tribromophenol	100		107		10-120
4-Terphenyl-d14	82		87		41-149

PCBS

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-01
Client ID: P6TMW02_101625
Sample Location: SYRACUSE NY

Date Collected: 10/16/25 11:00
Date Received: 10/16/25
Field Prep: Refer to COC

Sample Depth:
Matrix: Water
Analytical Method: 1,8082A
Analytical Date: 10/23/25 10:32
Analyst: SDC

Extraction Method: EPA 3510C
Extraction Date: 10/22/25 10:38
Cleanup Method: EPA 3665A
Cleanup Date: 10/22/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/22/25

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Column
Polychlorinated Biphenyls by GC - Westborough Lab							
Aroclor 1016	ND		ug/l	0.071	0.021	1	A
Aroclor 1221	ND		ug/l	0.071	0.026	1	A
Aroclor 1232	ND		ug/l	0.071	0.026	1	A
Aroclor 1242	ND		ug/l	0.071	0.026	1	A
Aroclor 1248	ND		ug/l	0.071	0.026	1	A
Aroclor 1254	ND		ug/l	0.071	0.026	1	A
Aroclor 1260	ND		ug/l	0.071	0.026	1	A
Aroclor 1262	ND		ug/l	0.071	0.026	1	A
Aroclor 1268	ND		ug/l	0.071	0.026	1	A
PCBs, Total	ND		ug/l	0.071	0.021	1	A

Surrogate	% Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	72		30-150	A
Decachlorobiphenyl	62		30-150	A
2,4,5,6-Tetrachloro-m-xylene	73		30-150	B
Decachlorobiphenyl	67		30-150	B

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 1,8082A
Analytical Date: 10/23/25 09:57
Analyst: SDC

Extraction Method: EPA 3510C
Extraction Date: 10/22/25 10:38
Cleanup Method: EPA 3665A
Cleanup Date: 10/22/25
Cleanup Method: EPA 3660B
Cleanup Date: 10/22/25

Parameter	Result	Qualifier	Units	RL	MDL	Column
Polychlorinated Biphenyls by GC - Westborough Lab for sample(s): 01 Batch: WG2131090-1						
Aroclor 1016	ND		ug/l	0.071	0.021	A
Aroclor 1221	ND		ug/l	0.071	0.026	A
Aroclor 1232	ND		ug/l	0.071	0.026	A
Aroclor 1242	ND		ug/l	0.071	0.026	A
Aroclor 1248	ND		ug/l	0.071	0.026	A
Aroclor 1254	ND		ug/l	0.071	0.026	A
Aroclor 1260	ND		ug/l	0.071	0.026	A
Aroclor 1262	ND		ug/l	0.071	0.026	A
Aroclor 1268	ND		ug/l	0.071	0.026	A
PCBs, Total	ND		ug/l	0.071	0.021	A

Surrogate	%Recovery	Qualifier	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	65		30-150	A
Decachlorobiphenyl	78		30-150	A
2,4,5,6-Tetrachloro-m-xylene	67		30-150	B
Decachlorobiphenyl	77		30-150	B

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits	Column
Polychlorinated Biphenyls by GC - Westborough Lab Associated sample(s): 01 Batch: WG2131090-2 WG2131090-3									
Aroclor 1016	69		68		40-140	1		50	A
Aroclor 1260	88		86		40-140	2		50	A

Surrogate	LCS %Recovery	Qual	LCSD %Recovery	Qual	Acceptance Criteria	Column
2,4,5,6-Tetrachloro-m-xylene	65		65		30-150	A
Decachlorobiphenyl	77		75		30-150	A
2,4,5,6-Tetrachloro-m-xylene	72		69		30-150	B
Decachlorobiphenyl	91		84		30-150	B

METALS

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-01 Date Collected: 10/16/25 11:00

Client ID: P6TMW02_101625 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:

Matrix: Water

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Total Metals - Mansfield Lab											
Aluminum, Total	12.8		mg/l	0.0100	0.00327	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Antimony, Total	ND		mg/l	0.00400	0.00042	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Arsenic, Total	0.00471		mg/l	0.00050	0.00016	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Barium, Total	0.2820		mg/l	0.00050	0.00017	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Beryllium, Total	0.00082		mg/l	0.00050	0.00010	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Cadmium, Total	0.00013	J	mg/l	0.00020	0.00005	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Calcium, Total	352.		mg/l	1.00	0.394	10	10/22/25 13:03	10/23/25 17:03	EPA 3005A	1,6020B	CEY
Chromium, Total	0.02400		mg/l	0.00100	0.00017	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Cobalt, Total	0.02020		mg/l	0.00050	0.00016	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Copper, Total	0.04887		mg/l	0.00100	0.00038	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Iron, Total	31.0		mg/l	0.0500	0.0191	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Lead, Total	0.03274		mg/l	0.00100	0.00034	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Magnesium, Total	87.8		mg/l	0.0700	0.0242	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Manganese, Total	1.498		mg/l	0.00100	0.00044	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Mercury, Total	ND		mg/l	0.00020	0.00009	1	10/22/25 13:45	10/22/25 23:48	EPA 7470A	1,7470A	RDB
Nickel, Total	0.04866		mg/l	0.00200	0.00055	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Potassium, Total	3.40		mg/l	0.100	0.0309	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Selenium, Total	0.00358	J	mg/l	0.00500	0.00173	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Silver, Total	0.00021	J	mg/l	0.00040	0.00016	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Sodium, Total	596.		mg/l	5.00	0.293	10	10/22/25 13:03	10/23/25 17:03	EPA 3005A	1,6020B	CEY
Thallium, Total	0.00028	J	mg/l	0.00100	0.00014	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Vanadium, Total	0.02407		mg/l	0.00500	0.00157	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
Zinc, Total	0.08302		mg/l	0.01000	0.00341	1	10/22/25 13:03	10/23/25 16:38	EPA 3005A	1,6020B	CEY
General Chemistry - Mansfield Lab											
Chromium, Trivalent	0.024	J	mg/l	0.050	0.015	1		10/23/25 16:38	NA	107,-	

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-01 Date Collected: 10/16/25 11:00

Client ID: P6TMW02_101625 Date Received: 10/16/25

Sample Location: SYRACUSE NY Field Prep: Refer to COC

Sample Depth:

Matrix: Water

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Prep Method	Analytical Method	Analyst
Dissolved Metals - Mansfield Lab											
Aluminum, Dissolved	ND		mg/l	0.0200	0.00654	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Antimony, Dissolved	ND		mg/l	0.00800	0.00085	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Arsenic, Dissolved	ND		mg/l	0.00100	0.00033	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Barium, Dissolved	0.08763		mg/l	0.00100	0.00034	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Beryllium, Dissolved	ND		mg/l	0.00100	0.00021	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Cadmium, Dissolved	ND		mg/l	0.00040	0.00011	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Calcium, Dissolved	280.		mg/l	0.200	0.0788	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Chromium, Dissolved	ND		mg/l	0.00200	0.00035	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Cobalt, Dissolved	0.00307		mg/l	0.00100	0.00032	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Copper, Dissolved	0.00211		mg/l	0.00200	0.00076	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Iron, Dissolved	0.0643	J	mg/l	0.100	0.0382	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Lead, Dissolved	ND		mg/l	0.00200	0.00068	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Magnesium, Dissolved	64.6		mg/l	0.140	0.0484	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Manganese, Dissolved	1.114		mg/l	0.00200	0.00088	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Mercury, Dissolved	ND		mg/l	0.00020	0.00009	1	10/22/25 19:02	10/23/25 10:24	EPA 7470A	1,7470A	RDB
Nickel, Dissolved	0.00489		mg/l	0.00400	0.00111	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Potassium, Dissolved	2.15		mg/l	0.200	0.0618	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Selenium, Dissolved	ND		mg/l	0.0100	0.00346	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Silver, Dissolved	ND		mg/l	0.00080	0.00032	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Sodium, Dissolved	630.		mg/l	5.00	0.293	10	10/22/25 15:56	10/23/25 11:28	EPA 3005A	1,6020B	BLR
Thallium, Dissolved	ND		mg/l	0.00200	0.00028	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Vanadium, Dissolved	ND		mg/l	0.01000	0.00314	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR
Zinc, Dissolved	ND		mg/l	0.02000	0.00682	2	10/22/25 15:56	10/23/25 11:22	EPA 3005A	1,6020B	BLR

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Total Metals - Mansfield Lab for sample(s): 01 Batch: WG2131254-1										
Aluminum, Total	ND		mg/l	0.0100	0.00327	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Antimony, Total	ND		mg/l	0.00400	0.00042	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Arsenic, Total	ND		mg/l	0.00050	0.00016	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Barium, Total	ND		mg/l	0.00050	0.00017	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Beryllium, Total	ND		mg/l	0.00050	0.00010	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Cadmium, Total	ND		mg/l	0.00020	0.00005	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Calcium, Total	ND		mg/l	0.100	0.0394	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Chromium, Total	ND		mg/l	0.00100	0.00017	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Cobalt, Total	ND		mg/l	0.00050	0.00016	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Copper, Total	ND		mg/l	0.00100	0.00038	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Iron, Total	ND		mg/l	0.0500	0.0191	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Lead, Total	ND		mg/l	0.00100	0.00034	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Magnesium, Total	ND		mg/l	0.0700	0.0242	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Manganese, Total	0.00075	J	mg/l	0.00100	0.00044	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Nickel, Total	ND		mg/l	0.00200	0.00055	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Potassium, Total	ND		mg/l	0.100	0.0309	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Selenium, Total	ND		mg/l	0.00500	0.00173	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Silver, Total	ND		mg/l	0.00040	0.00016	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Sodium, Total	ND		mg/l	0.500	0.0293	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Thallium, Total	ND		mg/l	0.00100	0.00014	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Vanadium, Total	ND		mg/l	0.00500	0.00157	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY
Zinc, Total	ND		mg/l	0.01000	0.00341	1	10/22/25 13:03	10/23/25 15:47	1,6020B	CEY

Prep Information

Digestion Method: EPA 3005A

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Total Metals - Mansfield Lab for sample(s): 01 Batch: WG2131256-1										
Mercury, Total	ND		mg/l	0.00020	0.00009	1	10/22/25 13:45	10/22/25 23:41	1,7470A	RDB

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Prep Information

Digestion Method: EPA 7470A

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Dissolved Metals - Mansfield Lab for sample(s): 01 Batch: WG2131318-1										
Aluminum, Dissolved	ND		mg/l	0.0100	0.00327	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Antimony, Dissolved	ND		mg/l	0.00400	0.00042	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Arsenic, Dissolved	ND		mg/l	0.00050	0.00016	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Barium, Dissolved	ND		mg/l	0.00050	0.00017	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Beryllium, Dissolved	ND		mg/l	0.00050	0.00010	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Cadmium, Dissolved	ND		mg/l	0.00020	0.00005	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Calcium, Dissolved	ND		mg/l	0.100	0.0394	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Chromium, Dissolved	ND		mg/l	0.00100	0.00017	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Cobalt, Dissolved	ND		mg/l	0.00050	0.00016	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Copper, Dissolved	ND		mg/l	0.00100	0.00038	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Iron, Dissolved	ND		mg/l	0.0500	0.0191	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Lead, Dissolved	ND		mg/l	0.00100	0.00034	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Magnesium, Dissolved	ND		mg/l	0.0700	0.0242	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Manganese, Dissolved	ND		mg/l	0.00100	0.00044	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Nickel, Dissolved	ND		mg/l	0.00200	0.00055	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Potassium, Dissolved	ND		mg/l	0.100	0.0309	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Selenium, Dissolved	ND		mg/l	0.00500	0.00173	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Silver, Dissolved	ND		mg/l	0.00040	0.00016	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Sodium, Dissolved	ND		mg/l	0.500	0.0293	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Thallium, Dissolved	ND		mg/l	0.00100	0.00014	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Vanadium, Dissolved	ND		mg/l	0.00500	0.00157	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR
Zinc, Dissolved	ND		mg/l	0.01000	0.00341	1	10/22/25 15:56	10/23/25 08:31	1,6020B	BLR

Prep Information

Digestion Method: EPA 3005A

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Method Blank Analysis
Batch Quality Control

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
Dissolved Metals - Mansfield Lab for sample(s): 01 Batch: WG2131321-1										
Mercury, Dissolved	ND		mg/l	0.00020	0.00009	1	10/22/25 19:02	10/23/25 10:07	1,7470A	RDB

Prep Information

Digestion Method: EPA 7470A

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01 Batch: WG2131254-2								
Aluminum, Total	90		-		80-120	-		
Antimony, Total	103		-		80-120	-		
Arsenic, Total	116		-		80-120	-		
Barium, Total	105		-		80-120	-		
Beryllium, Total	103		-		80-120	-		
Cadmium, Total	106		-		80-120	-		
Calcium, Total	107		-		80-120	-		
Chromium, Total	106		-		80-120	-		
Cobalt, Total	109		-		80-120	-		
Copper, Total	114		-		80-120	-		
Iron, Total	116		-		80-120	-		
Lead, Total	105		-		80-120	-		
Magnesium, Total	94		-		80-120	-		
Manganese, Total	106		-		80-120	-		
Nickel, Total	113		-		80-120	-		
Potassium, Total	107		-		80-120	-		
Selenium, Total	112		-		80-120	-		
Silver, Total	105		-		80-120	-		
Sodium, Total	98		-		80-120	-		
Thallium, Total	112		-		80-120	-		
Vanadium, Total	107		-		80-120	-		

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	LCSD %Recovery	%Recovery Limits	RPD	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01 Batch: WG2131254-2					
Zinc, Total	115	-	80-120	-	
Total Metals - Mansfield Lab Associated sample(s): 01 Batch: WG2131256-2					
Mercury, Total	101	-	80-120	-	20

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	LCSD %Recovery	%Recovery Limits	RPD	RPD Limits
Dissolved Metals - Mansfield Lab Associated sample(s): 01 Batch: WG2131318-2					
Aluminum, Dissolved	96	-	80-120	-	
Antimony, Dissolved	84	-	80-120	-	
Arsenic, Dissolved	99	-	80-120	-	
Barium, Dissolved	99	-	80-120	-	
Beryllium, Dissolved	106	-	80-120	-	
Cadmium, Dissolved	99	-	80-120	-	
Calcium, Dissolved	108	-	80-120	-	
Chromium, Dissolved	99	-	80-120	-	
Cobalt, Dissolved	100	-	80-120	-	
Copper, Dissolved	104	-	80-120	-	
Iron, Dissolved	107	-	80-120	-	
Lead, Dissolved	98	-	80-120	-	
Magnesium, Dissolved	100	-	80-120	-	
Manganese, Dissolved	98	-	80-120	-	
Nickel, Dissolved	100	-	80-120	-	
Potassium, Dissolved	100	-	80-120	-	
Selenium, Dissolved	100	-	80-120	-	
Silver, Dissolved	100	-	80-120	-	
Sodium, Dissolved	102	-	80-120	-	
Thallium, Dissolved	101	-	80-120	-	
Vanadium, Dissolved	102	-	80-120	-	

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	LCSD %Recovery	%Recovery Limits	RPD	RPD Limits
Dissolved Metals - Mansfield Lab Associated sample(s): 01 Batch: WG2131318-2					
Zinc, Dissolved	101	-	80-120	-	
Dissolved Metals - Mansfield Lab Associated sample(s): 01 Batch: WG2131321-2					
Mercury, Dissolved	102	-	80-120	-	

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01	QC Batch ID: WG2131254-3	WG2131254-4	QC Sample: L2565756-10	Client ID: MS Sample								
Aluminum, Total	0.018	2	1.84	91		1.82	90		75-125	1		20
Antimony, Total	ND	0.5	0.5092	102		0.5065	101		75-125	1		20
Arsenic, Total	0.0076	0.12	0.1420	112		0.1437	113		75-125	1		20
Barium, Total	0.0913	2	2.147	103		2.120	101		75-125	1		20
Beryllium, Total	ND	0.05	0.05062	101		0.05085	102		75-125	0		20
Cadmium, Total	ND	0.053	0.05616	106		0.05571	105		75-125	1		20
Calcium, Total	47.2	10	58.4	112		57.8	106		75-125	1		20
Chromium, Total	ND	0.2	0.2116	106		0.2102	105		75-125	1		20
Cobalt, Total	ND	0.5	0.5274	105		0.5291	106		75-125	0		20
Copper, Total	ND	0.25	0.2761	110		0.2741	110		75-125	1		20
Iron, Total	0.151	1	1.25	110		1.28	113		75-125	2		20
Lead, Total	ND	0.53	0.5616	106		0.5572	105		75-125	1		20
Magnesium, Total	14.5	10	22.8	83		23.9	94		75-125	5		20
Manganese, Total	0.1820	0.5	0.7128	106		0.7120	106		75-125	0		20
Nickel, Total	ND	0.5	0.5435	109		0.5412	108		75-125	0		20
Potassium, Total	2.82	10	13.0	102		13.4	106		75-125	3		20
Selenium, Total	ND	0.12	0.123	102		0.132	110		75-125	7		20
Silver, Total	ND	0.05	0.05204	104		0.05168	103		75-125	1		20
Sodium, Total	16.6	10	25.1	85		26.1	95		75-125	4		20

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2131254-3 WG2131254-4 QC Sample: L2565756-10 Client ID: MS Sample												
Thallium, Total	ND	0.12	0.1355	113		0.1350	112		75-125	0		20
Vanadium, Total	ND	0.5	0.5412	108		0.5310	106		75-125	2		20
Zinc, Total	0.0113	0.5	0.5684	111		0.5692	112		75-125	0		20
Total Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2131256-3 QC Sample: L2565713-01 Client ID: P6TMW02_101625												
Mercury, Total	ND	0.005	0.00504	101		-	-		75-125	-		

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Dissolved Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2131318-3 QC Sample: L2565575-01 Client ID: MS Sample												
Aluminum, Dissolved	0.013	2	2.07	103		-	-		75-125	-		
Antimony, Dissolved	0.0005J	0.5	0.4509	90		-	-		75-125	-		
Arsenic, Dissolved	0.00063	0.12	0.1259	104		-	-		75-125	-		
Barium, Dissolved	0.0568	2	2.095	102		-	-		75-125	-		
Beryllium, Dissolved	ND	0.05	0.05294	106		-	-		75-125	-		
Cadmium, Dissolved	0.00010J	0.053	0.05382	102		-	-		75-125	-		
Calcium, Dissolved	57.9	10	70.5	**126**	Q	-	-		75-125	-		
Chromium, Dissolved	0.0002J	0.2	0.2072	104		-	-		75-125	-		
Cobalt, Dissolved	0.0009	0.5	0.5187	104		-	-		75-125	-		
Copper, Dissolved	0.0020	0.25	0.2648	105		-	-		75-125	-		
Iron, Dissolved	0.380	1	1.43	105		-	-		75-125	-		
Lead, Dissolved	ND	0.53	0.5335	101		-	-		75-125	-		
Magnesium, Dissolved	6.46	10	16.9	104		-	-		75-125	-		
Manganese, Dissolved	0.7126	0.5	1.246	107		-	-		75-125	-		
Nickel, Dissolved	0.0011J	0.5	0.5348	107		-	-		75-125	-		
Potassium, Dissolved	14.0	10	24.9	109		-	-		75-125	-		
Selenium, Dissolved	ND	0.12	0.125	104		-	-		75-125	-		
Silver, Dissolved	ND	0.05	0.05009	100		-	-		75-125	-		
Sodium, Dissolved	60.7	10	73.9	**132**	Q	-	-		75-125	-		

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565713
Report Date: 10/30/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
Dissolved Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2131318-3 QC Sample: L2565575-01 Client ID: MS Sample												
Thallium, Dissolved	ND	0.12	0.1249	104		-	-		75-125	-		
Vanadium, Dissolved	ND	0.5	0.5291	106		-	-		75-125	-		
Zinc, Dissolved	ND	0.5	0.5292	106		-	-		75-125	-		
Dissolved Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2131321-3 QC Sample: L2565575-02 Client ID: MS Sample												
Mercury, Dissolved	ND	0.005	0.00472	94		-	-		75-125	-		

Lab Duplicate Analysis

Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI

Project Number: 170859701

Lab Number: L2565713

Report Date: 10/30/25

Parameter	Native Sample	Duplicate Sample	Units	RPD	Qual	RPD Limits
Total Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2131256-4 QC Sample: L2565713-01 Client ID: P6TMW02_101625						
Mercury, Total	ND	0.00012J	mg/l	NC		20
Dissolved Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2131318-4 QC Sample: L2565575-01 Client ID: DUP Sample						
Arsenic, Dissolved	0.00063	0.00066	mg/l	5		20
Cadmium, Dissolved	0.00010J	0.00009J	mg/l	NC		20
Lead, Dissolved	ND	ND	mg/l	NC		20
Dissolved Metals - Mansfield Lab Associated sample(s): 01 QC Batch ID: WG2131321-4 QC Sample: L2565575-02 Client ID: DUP Sample						
Mercury, Dissolved	ND	ND	mg/l	NC		20

INORGANICS
&
MISCELLANEOUS

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

SAMPLE RESULTS

Lab ID: L2565713-01
Client ID: P6TMW02_101625
Sample Location: SYRACUSE NY
Sample Depth:
Matrix: Water
Date Collected: 10/16/25 11:00
Date Received: 10/16/25
Field Prep: Refer to COC

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab										
Cyanide, Total	ND		mg/l	0.005	0.001	1	10/22/25 11:15	10/22/25 15:36	1,9010C/9012B	JER
Chromium, Hexavalent	ND		mg/l	0.050	0.015	5	10/17/25 10:30	10/17/25 10:48	1,7196A	DMO

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

Method Blank Analysis
Batch Quality Control

Parameter	Result	Qualifier	Units	RL	MDL	Dilution Factor	Date Prepared	Date Analyzed	Analytical Method	Analyst
General Chemistry - Westborough Lab for sample(s): 01 Batch: WG2129210-1										
Chromium, Hexavalent	ND		mg/l	0.010	0.003	1	10/17/25 10:30	10/17/25 10:46	1,7196A	DMO
General Chemistry - Westborough Lab for sample(s): 01 Batch: WG2131130-1										
Cyanide, Total	ND		mg/l	0.005	0.001	1	10/22/25 11:15	10/22/25 15:32	1,9010C/9012B	JER

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565713
Report Date: 10/30/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
General Chemistry - Westborough Lab Associated sample(s): 01 Batch: WG2129210-2								
Chromium, Hexavalent	96		-		85-115	-		
General Chemistry - Westborough Lab Associated sample(s): 01 Batch: WG2131130-2 WG2131130-3								
Cyanide, Total	90		92		85-115	2		20

Matrix Spike Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701
Lab Number: L2565713
Report Date: 10/30/25

Parameter	Native Sample	MS Added	MS Found	MS %Recovery	Qual	MSD Found	MSD %Recovery	Qual	Recovery Limits	RPD	Qual	RPD Limits
General Chemistry - Westborough Lab Associated sample(s): 01 QC Batch ID: WG2129210-4 QC Sample: L2565713-01 Client ID: P6TMW02_101625												
Chromium, Hexavalent	ND	0.5	0.512	102		-	-		85-115	-		
General Chemistry - Westborough Lab Associated sample(s): 01 QC Batch ID: WG2131130-4 WG2131130-5 QC Sample: L2565759-01 Client ID: MS Sample												
Cyanide, Total	0.002J	0.2	0.187	94		0.183	92		80-120	2		20

Lab Duplicate Analysis

Batch Quality Control

Project Name: EAST ADAMS REDEVELOPMENT PHVI

Project Number: 170859701

Lab Number: L2565713

Report Date: 10/30/25

Parameter	Native Sample	Duplicate Sample	Units	RPD	Qual	RPD Limits
General Chemistry - Westborough Lab Associated sample(s): 01 QC Batch ID: WG2129210-3 QC Sample: L2565713-01 Client ID: P6TMW02_101625						
Chromium, Hexavalent	ND	ND	mg/l	NC		20

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565713
Report Date: 10/30/25

Sample Receipt and Container Information

Were project specific reporting limits specified? YES

Cooler Information

Cooler	Custody Seal
A	Absent
B	Absent
C	Absent
D	Absent

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565713-01A	Vial HCl preserved	NA	NA			Y	Absent		NYTCL-8260(14)
L2565713-01B	Vial HCl preserved	NA	NA			Y	Absent		NYTCL-8260(14)
L2565713-01C	Vial HCl preserved	NA	NA			Y	Absent		NYTCL-8260(14)
L2565713-01D	Amber 100ml unpreserved	NA	NA			Y	Absent		NYTCL-8082-RVT(365),NYTCL-8270-RVT(7),L-EXT-8081(7),NYTCL-8270-SIM-RVT(7)
L2565713-01E	Amber 100ml unpreserved	NA	NA			Y	Absent		NYTCL-8082-RVT(365),NYTCL-8270-RVT(7),L-EXT-8081(7),NYTCL-8270-SIM-RVT(7)
L2565713-01F	Amber 100ml unpreserved	NA	NA			Y	Absent		NYTCL-8082-RVT(365),NYTCL-8270-RVT(7),L-EXT-8081(7),NYTCL-8270-SIM-RVT(7)
L2565713-01G	Amber 100ml unpreserved	NA	NA			Y	Absent		NYTCL-8082-RVT(365),NYTCL-8270-RVT(7),L-EXT-8081(7),NYTCL-8270-SIM-RVT(7)
L2565713-01H	Amber 100ml unpreserved	NA	NA			Y	Absent		NYTCL-8082-RVT(365),NYTCL-8270-RVT(7),L-EXT-8081(7),NYTCL-8270-SIM-RVT(7)
L2565713-01I	Amber 100ml unpreserved	NA	NA			Y	Absent		NYTCL-8082-RVT(365),NYTCL-8270-RVT(7),L-EXT-8081(7),NYTCL-8270-SIM-RVT(7)
L2565713-01J	Plastic 250ml unpreserved	NA	NA			Y	Absent		HEXCR-7196(1)
L2565713-01K	Plastic 250ml NaOH preserved	NA	>12	>12		Y	Absent		TCN-9010(14)

*Values in parentheses indicate holding time in days

Project Name: EAST ADAMS REDEVELOPMENT PHVI
Project Number: 170859701

Lab Number: L2565713
Report Date: 10/30/25

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565713-01L	Plastic 250ml HNO3 preserved	NA	<2	<2		Y	Absent		SE-6020T(180),FE-6020T(180),TL-6020T(180),BA-6020T(180),CR-6020T(180),NI-6020T(180),CA-6020T(180),K-6020T(180),CU-6020T(180),NA-6020T(180),ZN-6020T(180),PB-6020T(180),BE-6020T(180),MN-6020T(180),SB-6020T(180),AS-6020T(180),V-6020T(180),AL-6020T(180),HG-T(28),CD-6020T(180),AG-6020T(180),MG-6020T(180),CO-6020T(180)
L2565713-01M	Plastic 120ml HNO3 preserved Filtrates	NA	<2	<2		Y	Absent		K-6020S(180),V-6020S(180),CU-6020S(180),SE-6020S(180),MN-6020S(180),CO-6020S(180),ZN-6020S(180),BE-6020S(180),MG-6020S(180),CR-6020S(180),CA-6020S(180),FE-6020S(180),PB-6020S(180),BA-6020S(180),NA-6020S(180),NI-6020S(180),TL-6020S(180),AG-6020S(180),AS-6020S(180),SB-6020S(180),CD-6020S(180),AL-6020S(180),HG-S(28)
L2565713-01N	Amber 1L unpreserved	NA	NA			Y	Absent		L-EXT-8151(7)
L2565713-01O	Amber 1L unpreserved	NA	NA			Y	Absent		L-EXT-8151(7)
L2565713-02A	Vial HCl preserved	NA	NA			Y	Absent		NYTCL-8260(14)
L2565713-02B	Vial HCl preserved	NA	NA			Y	Absent		NYTCL-8260(14)
L2565713-02C	Vial HCl preserved	NA	NA			Y	Absent		NYTCL-8260(14)
L2565713-04A	Vial HCl preserved	NA	NA			Y	Absent		NYTCL-8260(14)
L2565713-04B	Vial HCl preserved	NA	NA			Y	Absent		NYTCL-8260(14)
L2565713-04C	Vial HCl preserved	NA	NA			Y	Absent		NYTCL-8260(14)

*Values in parentheses indicate holding time in days

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565713
Project Number:	170859701	**Report Date:**	10/30/25

GLOSSARY

Acronyms

DL	- Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the limit of quantitation (LOQ). The DL includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)
EDL	- Estimated Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the reporting limit (RL). The EDL includes any adjustments from dilutions, concentrations or moisture content, where applicable. The use of EDLs is specific to the analysis of PAHs using Solid-Phase Microextraction (SPME).
EMPC	- Estimated Maximum Possible Concentration: The concentration that results from the signal present at the retention time of an analyte when the ions meet all of the identification criteria except the ion abundance ratio criteria. An EMPC is a worst-case estimate of the concentration.
EPA	- Environmental Protection Agency.
LCS	- Laboratory Control Sample: A sample matrix, free from the analytes of interest, spiked with verified known amounts of analytes or a material containing known and verified amounts of analytes.
LCSD	- Laboratory Control Sample Duplicate: Refer to LCS.
LFB	- Laboratory Fortified Blank: A sample matrix, free from the analytes of interest, spiked with verified known amounts of analytes or a material containing known and verified amounts of analytes.
LOD	- Limit of Detection: This value represents the level to which a target analyte can reliably be detected for a specific analyte in a specific matrix by a specific method. The LOD includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)
LOQ	- Limit of Quantitation: The value at which an instrument can accurately measure an analyte at a specific concentration. The LOQ includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.) Limit of Quantitation: The value at which an instrument can accurately measure an analyte at a specific concentration. The LOQ includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)
MDL	- Method Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the reporting limit (RL). The MDL includes any adjustments from dilutions, concentrations or moisture content, where applicable.
MS	- Matrix Spike Sample: A sample prepared by adding a known mass of target analyte to a specified amount of matrix sample for which an independent estimate of target analyte concentration is available. For Method 332.0, the spike recovery is calculated using the native concentration, including estimated values.
MSD	- Matrix Spike Sample Duplicate: Refer to MS.
NA	- Not Applicable.
NC	- Not Calculated: Term is utilized when one or more of the results utilized in the calculation are non-detect at the parameter's reporting unit.
NDPA/DPA	- N-Nitrosodiphenylamine/Diphenylamine.
NI	- Not Ignitable.
NP	- Non-Plastic: Term is utilized for the analysis of Atterberg Limits in soil.
NR	- No Results: Term is utilized when 'No Target Compounds Requested' is reported for the analysis of Volatile or Semivolatile Organic TIC only requests.
RL	- Reporting Limit: The value at which an instrument can accurately measure an analyte at a specific concentration. The RL includes any adjustments from dilutions, concentrations or moisture content, where applicable.
RPD	- Relative Percent Difference: The results from matrix and/or matrix spike duplicates are primarily designed to assess the precision of analytical results in a given matrix and are expressed as relative percent difference (RPD). Values which are less than five times the reporting limit for any individual parameter are evaluated by utilizing the absolute difference between the values; although the RPD value will be provided in the report.
SRM	- Standard Reference Material: A reference sample of a known or certified value that is of the same or similar matrix as the associated field samples.
STLP	- Semi-dynamic Tank Leaching Procedure per EPA Method 1315.
TEF	- Toxic Equivalency Factors: The values assigned to each dioxin and furan to evaluate their toxicity relative to 2,3,7,8-TCDD.
TEQ	- Toxic Equivalent: The measure of a sample's toxicity derived by multiplying each dioxin and furan by its corresponding TEF and then summing the resulting values.
TIC	- Tentatively Identified Compound: A compound that has been identified to be present and is not part of the target compound list (TCL) for the method and/or program. All TICs are qualitatively identified and reported as estimated concentrations.

Report Format: DU Report with 'J' Qualifiers

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565713
Project Number:	170859701	**Report Date:**	10/30/25

Footnotes

1 - The reference for this analyte should be considered modified since this analyte is absent from the target analyte list of the original method.

Terms

Analytical Method: Both the document from which the method originates and the analytical reference method. (Example: EPA 8260B is shown as 1,8260B.) The codes for the reference method documents are provided in the References section of the Addendum.

Chlordane: The target compound Chlordane (CAS No. 57-74-9) is reported for GC ECD analyses. Per EPA,this compound "refers to a mixture of chlordane isomers, other chlorinated hydrocarbons and numerous other components." (Reference: USEPA Toxicological Review of Chlordane, In Support of Summary Information on the Integrated Risk Information System (IRIS), December 1997.)

Difference: With respect to Total Oxidizable Precursor (TOP) Assay analysis, the difference is defined as the Post-Treatment value minus the Pre-Treatment value.

Final pH: As it pertains to Sample Receipt & Container Information section of the report, Final pH reflects pH of container determined after adjustment at the laboratory, if applicable. If no adjustment required, value reflects Initial pH.

Frozen Date/Time: With respect to Volatile Organics in soil, Frozen Date/Time reflects the date/time at which associated Reagent Water-preserved vials were initially frozen. Note: If frozen date/time is beyond 48 hours from sample collection, value will be reflected in 'bold'.

Gasoline Range Organics (GRO): Gasoline Range Organics (GRO) results include all chromatographic peaks eluting from Methyl tert butyl ether through Naphthalene, with the exception of GRO analysis in support of State of Ohio programs, which includes all chromatographic peaks eluting from Hexane through Dodecane.

Initial pH: As it pertains to Sample Receipt & Container Information section of the report, Initial pH reflects pH of container determined upon receipt, if applicable.

PAH Total: With respect to Alkylated PAH analyses, the 'PAHs, Total' result is defined as the summation of results for all or a subset of the following compounds: Naphthalene, C1-C4 Naphthalenes, 2-Methylnaphthalene, 1-Methylnaphthalene, Biphenyl, Acenaphthylene, Acenaphthene, Fluorene, C1-C3 Fluorenes, Phenanthrene, C1-C4 Phenanthrenes/Anthracenes, Anthracene, Fluoranthene, Pyrene, C1-C4 Fluoranthenes/Pyrenes, Benz(a)anthracene, Chrysene, C1-C4 Chrysenes, Benzo(b)fluoranthene, Benzo(j)+(k)fluoranthene, Benzo(e)pyrene, Benzo(a)pyrene, Perylene, Indeno(1,2,3-cd)pyrene, Dibenz(ah)+(ac)anthracene, Benzo(g,h,i)perylene. If a 'Total' result is requested, the results of its individual components will also be reported.

PFAS Total: With respect to PFAS analyses, the 'PFAS, Total (5)' result is defined as the summation of results for: PFHpA, PFHxS, PFOA, PFNA and PFOS. In addition, the 'PFAS, Total (6)' result is defined as the summation of results for: PFHpA, PFHxS, PFOA, PFNA, PFDA and PFOS. For MassDEP DW compliance analysis only, the 'PFAS, Total (6)' result is defined as the summation of results at or above the RL. Note: If a 'Total' result is requested, the results of its individual components will also be reported.

Total: With respect to Organic analyses, a 'Total' result is defined as the summation of results for individual isomers or Aroclors. If a 'Total' result is requested, the results of its individual components will also be reported. This is applicable to 'Total' results for methods 8260, 8081 and 8082.

Data Qualifiers

A - Spectra identified as "Aldol Condensates" are byproducts of the extraction/concentration procedures when acetone is introduced in the process.

B - The analyte was detected above the reporting limit in the associated method blank. Flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank. For MCP-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank. For DOD-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank AND the analyte was detected above one-half the reporting limit (or above the reporting limit for common lab contaminants) in the associated method blank. For NJ-Air-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte above the reporting limit. For NJ-related projects (excluding Air), flag only applies to associated field samples that have detectable concentrations of the analyte, which was detected above the reporting limit in the associated method blank or above five times the reporting limit for common lab contaminants (Phthalates, Acetone, Methylene Chloride, 2-Butanone).

C - Co-elution: The target analyte co-elutes with a known lab standard (i.e. surrogate, internal standards, etc.) for co-extracted analyses.

D - Concentration of analyte was quantified from diluted analysis. Flag only applies to field samples that have detectable concentrations of the analyte.

E - Concentration of analyte exceeds the range of the calibration curve and/or linear range of the instrument.

F - The ratio of quantifier ion response to qualifier ion response falls outside of the laboratory criteria. Results are considered to be an estimated maximum concentration.

G - The concentration may be biased high due to matrix interferences (i.e, co-elution) with non-target compound(s). The result should be considered estimated.

H - The analysis of pH was performed beyond the regulatory-required holding time of 15 minutes from the time of sample collection.

I - The lower value for the two columns has been reported due to obvious interference.

J - Estimated value. The Target analyte concentration is below the quantitation limit (RL), but above the Method Detection Limit (MDL) or Estimated Detection Limit (EDL) for SPME-related analyses. This represents an estimated concentration for Tentatively Identified Compounds (TICs). For calculated parameters, this represents that one or more values used in the calculation were

Report Format: DU Report with 'J' Qualifiers

Project Name:	EAST ADAMS REDEVELOPMENT PHVI	**Lab Number:**	L2565713
Project Number:	170859701	**Report Date:**	10/30/25

Data Qualifiers

estimated.

M - Reporting Limit (RL) exceeds the MCP CAM Reporting Limit for this analyte.

ND - Not detected at the method detection limit (MDL) for the sample, or estimated detection limit (EDL) for SPME-related analyses.

NJ - Presumptive evidence of compound. This represents an estimated concentration for Tentatively Identified Compounds (TICs), where the identification is based on a mass spectral library search.

P - The RPD between the results for the two columns exceeds the method-specified criteria.

Q - The quality control sample exceeds the associated acceptance criteria. For DOD-related projects, LCS and/or Continuing Calibration Standard exceedences are also qualified on all associated sample results. Note: This flag is not applicable for matrix spike recoveries when the sample concentration is greater than 4x the spike added or for batch duplicate RPD when the sample concentrations are less than 5x the RL. (Metals only.)

R - Analytical results are from sample re-analysis.

RE - Analytical results are from sample re-extraction.

S - Analytical results are from modified screening analysis.

V - The surrogate associated with this target analyte has a recovery outside the QC acceptance limits. (Applicable to MassDEP DW Compliance samples only.)

Z - The batch matrix spike and/or duplicate associated with this target analyte has a recovery/RPD outside the QC acceptance limits. (Applicable to MassDEP DW Compliance samples only.)

Project Name: EAST ADAMS REDEVELOPMENT PHVI **Lab Number:** L2565713

Project Number: 170859701 **Report Date:** 10/30/25

REFERENCES

1 Test Methods for Evaluating Solid Waste: Physical/Chemical Methods. EPA SW-846. Third Edition. Updates I - VI, 2018.

107 Calculation method.

LIMITATION OF LIABILITIES

Pace Analytical Services performs services with reasonable care and diligence normal to the analytical testing laboratory industry. In the event of an error, the sole and exclusive responsibility of Pace Analytical Services shall be to re-perform the work at it's own expense. In no event shall Pace Analytical Services be held liable for any incidental, consequential or special damages, including but not limited to, damages in any way connected with the use of, interpretation of, information or analysis provided by Pace Analytical Services.

We strongly urge our clients to comply with EPA protocol regarding sample volume, preservation, cooling, containers, sampling procedures, holding time and splitting of samples in the field.

Certification Information

The following analytes are not included in our Primary NELAP Scope of Accreditation:

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581
EPA 624.1: m/p-xylene, o-xylene, Naphthalene
EPA 625.1: alpha-Terpineol
EPA 8260D: NPW: 1,2,4,5-Tetramethylbenzene; 4-Ethyltoluene; SCM: Iodomethane (methyl iodide), 1,2,4,5-Tetramethylbenzene; 4-Ethyltoluene.
EPA 8270E: NPW: Dimethylnaphthalene,1,4-Diphenylhydrazine, alpha-Terpineol, Azobenzene; SCM: Dimethylnaphthalene,1,4-Diphenylhydrazine.
SM4500: NPW: Amenable Cyanide; SCM: Total Phosphorus, TKN, NO2, NO3.

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
SM 2540D: TSS.
EPA TO-15: Halothane, 2,4,4-Trimethyl-2-pentene, 2,4,4-Trimethyl-1-pentene, Thiophene, 2-Methylthiophene, 3-Methylthiophene, 2-Ethylthiophene, 1,2,3-Trimethylbenzene, Indan, Indene, 1,2,4,5-Tetramethylbenzene, Benzothiophene, 1-Methylnaphthalene.
MADEP-APH.
Nonpotable Water: EPA RSK-175 Dissolved Gases
Biological Tissue Matrix: EPA 3050B

Mansfield Facility – 120 Forbes Blvd. Mansfield, MA 02048
EPA TO-15: Halothane, 2,4,4-Trimethyl-2-pentene, 2,4,4-Trimethyl-1-pentene, Thiophene, 2-Methylthiophene, 3-Methylthiophene, 2-Ethylthiophene, 1,2,3-Trimethylbenzene, Indan, Indene, 1,2,4,5-Tetramethylbenzene, Benzothiophene, 1-Methylnaphthalene.
Nonpotable Water: EPA RSK-175 Dissolved Gases

The following test method is not included in our New Jersey Secondary NELAP Scope of Accreditation:

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
Determination of Selected Perfluorinated Alkyl Substances by Solid Phase Extraction and Liquid Chromatography/Tandem Mass Spectrometry Isotope Dilution (via Alpha SOP 23528)

The following analytes are included in our Massachusetts DEP Scope of Accreditation

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581

Drinking Water
EPA 300.0: Chloride, Nitrate-N, Fluoride, Sulfate; **EPA 353.2**: Nitrate-N, Nitrite-N; **SM4500NO3-F**: Nitrate-N, Nitrite-N; **SM4500F-C, SM4500CN-CE, EPA 180.1, SM2130B, SM4500Cl-D, SM2320B, SM2540C, SM4500H-B, SM4500NO2-B**
EPA 524.2: THMs and VOCs; **EPA 504.1:** EDB, DBCP.
Microbiology: **SM9215B; SM9223-P/A, SM9223B-Colilert-QT,SM9222D**.

Non-Potable Water
SM4500H,B, EPA 120.1, SM2510B, SM2540C, SM2320B, SM4500CL-E, SM4500F-BC, SM4500NH3-BH: Ammonia-N and Kjeldahl-N, **EPA 350.1**: Ammonia-N, **LACHAT 10-107-06-1-B**: Ammonia-N, **EPA 351.1, SM4500NO3-F, EPA 353.2**: Nitrate-N**, SM4500P-E, SM4500P-B, E, SM4500SO4-E, SM5220D, EPA 410.4, SM5210B, SM5310C, SM4500CL-D, SM4500CL-G, EPA 1664, EPA 420.1, SM4500-CN-CE, SM2540D, EPA 300: Chloride, Sulfate, Nitrate.**
EPA 624.1: Volatile Halocarbons & Aromatics,
EPA 608.3: Chlordane, Toxaphene, Aldrin, alpha-BHC, beta-BHC, gamma-BHC, delta-BHC, Dieldrin, DDD, DDE, DDT, Endosulfan I, Endosulfan II, Endosulfan sulfate, Endrin, Endrin Aldehyde, Heptachlor, Heptachlor Epoxide, PCBs
EPA 625.1: SVOC (Acid/Base/Neutral Extractables).
Microbiology: **SM9223B-Colilert-QT; Enterolert-QT.**

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048

Drinking Water
EPA 200.7: Al, Ba, Cd, Cr, Cu, Fe, Mn, Ni, Na, Ag, Ca, Zn. **EPA 200.8:** Al, Sb, As, Ba, Be, Cd, Cr, Cu, Pb, Mn, Ni, Se, Ag, TL, Zn. **EPA 245.1** Hg.
EPA 522, EPA 537.1.

Non-Potable Water
EPA 200.7: Al, Sb, As, Be, Cd, Ca, Cr, Co, Cu, Fe, Pb, Mg, Mn, Mo, Ni, K, Se, Ag, Na, Sr, TL, Ti, V, Zn.
EPA 200.8: Al, Sb**,** As, Be, Cd, Ca, Cr, Cu, Fe, Pb, Mg, Mn, Ni, K, Se, Ag, Na, TL, Zn.
EPA 245.1: Hg. **EPA 245.7:** Hg.
SM2340B

Certification IDs:

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581
CT PH-0826, IL 200077, IN C-MA-03, KY kY98045, ME MA00086, MD 348, MA M-MA086, NH 2064, NJ MA935, NY 11148, NC (DW) 25700, NC (NPW/SCM) 666, OR MA-1316, PA 68-03671, RI LAO00065, TX T104704476, VT VT-0935, VA 460195

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
MA M-MA00030, CT PH-0825, ANAB/DoD L2474, IL 200081, IN C-MA-04, KY KY98046, LA 85084, ME MA00030, MI 9110, MN 025-999-495, NH 2062, NJ MA015, NY 11627, NC (NPW/SCM) 685, OR MA-0262, PA 68-02089, RI LAO00299, TX T-104704419, VT VT-0015, VA 460194, WA C954

Mansfield Facility – 120 Forbes Blvd. Mansfield, MA 02048
ANAB/DoD L2474, LA 245052, ME MA01156, MN 025-999-498, NH 2249, NJ MA025, NY 12191, OR 4203, TX T104704583, VA 460311, WA C1104.

For a complete listing of analytes and methods, please contact your Project Manager.

NEW YORK CHAIN OF CUSTODY

ALPHA

Westborough, MA 01581
8 Walkup Dr.
TEL: 508-898-9220
FAX: 508-898-9193

Mansfield, MA 02048
320 Forbes Blvd
TEL: 508-822-9300
FAX: 508-822-3288

Service Centers
Mahwah, NJ 07430: 35 Whitney Rd, Suite 5
Albany, NY 12205: 14 Walker Way
Tonawanda, NY 14150: 275 Cooper Ave, Suite 105

Page 1 of 1

Date Rec'd in Lab: 10/17/25

L2565713
LANGAN – NYC

Client Information

Client: Langan Engineering
Address: 368 9th Ave, 8th Fl
New York, NY 10001
Phone: 212-479-5402
Fax: N/A
Email: LhaleyClangan.com

Project Information

Project Name: East Adams Redevelopment Phase II
Project Location: Syracuse, NY
Project #: 1708659701
(Use Project name as Project #)
Project Manager: Lexi Haley
ALPHAQuote #: 216297

Turn-Around Time

Standard: X
Rush (only if pre approved):
Due Date:
# of Days:

Deliverables

- X ASP-A
- ASP-B
- EQuIS (1 File)
- EQuIS (4 File)
- Other

Billing Information

- Same as Client Info
PO #

Regulatory Requirement

- NY TOGS
- X NY Part 375
- AWQ Standards
- NY CP-51
- NY Restricted Use
- Other
- NY Unrestricted Use
- NYC Sewer Discharge

Disposal Site Information

Please identify below location of applicable disposal facilities.

Disposal Facility:
- NJ
- NY
- Other:

These samples have been previously analyzed by Alpha

Other project specific requirements/comments:

Please cc. ksemon@langan.com, pdinardo@langan.com and datamanagement@langan.com

Please specify Metals or TAL.

ANALYSIS

Sample Filtration
- Done
- Lab to do

Preservation
- Lab to do

(Please Specify below)

ALPHA Lab ID (Lab Use Only)	Sample ID	Collection Date	Collection Time	Sample Matrix	Sampler's Initials	Part 375 TCL VOCs, SVOCs	PCBs, pesticides, herbicides	TAL metals (including mercury)	hexavalent chromium	total cyanide	VOCs only	Total Bottle	Sample Specific Comments
65712-01	P6TMW02-101625	10/16/25		GW	JG	X	X	X	X	X	X		hold pest./herb.
-02	P6TMW10-101625	↓		↓	JG	X	X	X	X	X			hold pest./herb.
-03	P6TMW09-101625	↓		↓	JG	X	X	X	X	X			hold pest./herb.
-04	P6TMW09-101625	10/16/25		GW	JG	X					X		

Preservative Code:
A = None
B = HCl
C = HNO_3
D = H_2SO_4
E = NaOH
F = MeOH
G = $NaHSO_4$
H = $Na_2S_2O_3$
K/E = Zn Ac/NaOH
O = Other

Container Code
P = Plastic
A = Amber Glass
V = Vial
G = Glass
B = Bacteria Cup
C = Cube
O = Other
E = Encore
D = BOD Bottle

Westboro: Certification No: MA935
Mansfield: Certification No: MA015

Container Type
Preservative

Relinquished By:	Date/Time	Received By:	Date/Time
Isaac Geesa	10/16/25 1615		10/16 1615
	10/16 1700		10-16-25 1815
	10-16-25		10/17/25 0300

Please print clearly, legibly and completely. Samples can not be logged in and turnaround time clock will not start until any ambiguities are resolved. BY EXECUTING THIS COC, THE CLIENT HAS READ AND AGREES TO BE BOUND BY ALPHA'S TERMS & CONDITIONS. (See reverse side.)

Form No: 01-25 HC (rev. 30-Sept-2013)

Sample Delivery Group Summary

Pace Job Number : L2565713
Received : 16-OCT-2025
Reviewer : Owen Jefferson

Account Name : Langan Engineering & Environmental
Project Number : 170859701
Project Name : EAST ADAMS REDEVELOPMENT PHVI

Delivery Information

Samples Delivered By : Pace Courier

Chain of Custody : Present

Cooler Information

Cooler	Seal/Seal#	Preservation	Temperature(°C)	Additional Information
A	Absent/	Ice	2.2	
B	Absent/	Ice	4.2	
C	Absent/	Ice	3.9	
D	Absent/	Ice	4.0	

Condition Information

1) All samples on COC received? **NO**
Following samples were not received: -03

2) Extra samples received? **NO**

3) Are there any sample container discrepancies? **YES**
L2565713-01D (ARCHIVE) was received in extra container.
L2565713-01E (ARCHIVE) was received in extra container.
L2565713-01F (ARCHIVE) was received in extra container.
L2565713-01G (ARCHIVE) was received in extra container.
L2565713-01H (ARCHIVE) was received in extra container.
L2565713-01I (ARCHIVE) was received in extra container.
L2565713-01J (HEXCR-7196) was received in extra container.
L2565713-01K (ARCHIVE) was received in extra container.
L2565713-01L (ARCHIVE) was received in extra container.
L2565713-01M (ARCHIVE) was received in extra container.
L2565713-01N (ARCHIVE) was received in extra container.
L2565713-01O (ARCHIVE) was received in extra container.
Following containers were not received for listed analysis: -02 (HOLD-8081), -02 (NYTCL-8082-RVT), -02 (HOLD-8151), -02 (NYTCL-8270/SIM-RVT), -02(TAL-6020T), -02 (TL-6020T), -02 (HEXCR-7196), -02 (TCN-9010)

4) Are there any discrepancies between COC & sample labels? **NO**

5) Are samples in appropriate containers for requested analysis? **YES**

Sample Delivery Group Summary

Pace Job Number	: L2565713	Received	: 16-OCT-2025
		Reviewer	: Owen Jefferson
Account Name	: Langan Engineering & Environmental		
Project Number	: 170859701		
Project Name	: EAST ADAMS REDEVELOPMENT PHVI		

6) Are samples properly preserved for requested analysis? **NO**
Following containers were received with headspace: -04B

7) Are samples within holding time for requested analysis? **YES**

8) All sampling equipment returned? **NA**

Volatile Organics/VPH

1) Reagent Water Vials Frozen by Client? **NO**

ANALYTICAL REPORT

Lab Number:	L2565861
Client:	Langan Engineering & Environmental 21 Penn Plaza 360 West 31st Street, 8th Floor New York, NY 10001-2727
ATTN:	Lexi Haley
Phone:	(212) 479-5499
Project Name:	EAST ADAMS REDEVELOP PH. VI
Project Number:	170859701
Report Date:	10/23/25

The original project report/data package is held by Pace Analytical Services. This report/data package is paginated and should be reproduced only in its entirety. Pace Analytical Services holds no responsibility for results and/or data that are not consistent with the original.

Certifications & Approvals: NH ELAP (2249).

120 Forbes Boulevard, Mansfield, MA 02048-1806
508-822-9300 (Fax) 508-822-3288 800-624-9220 - www.pacelabs.com

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701

Lab Number: L2565861
Report Date: 10/23/25

Lab Sample ID	Client ID	Matrix	Sample Location	Collection Date/Time	Receive Date
L2565861-01	P6SV03_101625	SOIL_VAPOR	SYRACUSE, NY	10/16/25 15:47	10/16/25
L2565861-02	P6SV02_101625	SOIL_VAPOR	SYRACUSE, NY	10/16/25 16:02	10/16/25
L2565861-03	P6SV10_101625	SOIL_VAPOR	SYRACUSE, NY	10/16/25 16:22	10/16/25
L2565861-04	P6SV09_101625	SOIL_VAPOR	SYRACUSE, NY	10/16/25 16:35	10/16/25
L2565861-05	P6AA01_101625	AIR	SYRACUSE, NY	10/16/25 15:57	10/16/25

Project Name:	EAST ADAMS REDEVELOP PH. VI	**Lab Number:**	L2565861
Project Number:	170859701	**Report Date:**	10/23/25

Case Narrative

The samples were received in accordance with the Chain of Custody and no significant deviations were encountered during the preparation or analysis unless otherwise noted. Sample Receipt, Container Information, and the Chain of Custody are located at the back of the report.

Results contained within this report relate only to the samples submitted under this Pace Lab Number and meet NELAP requirements for all NELAP accredited parameters unless otherwise noted in the following narrative. The data presented in this report is organized by parameter (i.e. VOC, SVOC, etc.). Sample specific Quality Control data (i.e. Surrogate Spike Recovery) is reported at the end of the target analyte list for each individual sample, followed by the Laboratory Batch Quality Control at the end of each parameter. Tentatively Identified Compounds (TICs), if requested, are reported for compounds identified to be present and are not part of the method/program Target Compound List, even if only a subset of the TCL are being reported. If a sample was re-analyzed or re-extracted due to a required quality control corrective action and if both sets of data are reported, the Laboratory ID of the re-analysis or re-extraction is designated with an "R" or "RE", respectively.

When multiple Batch Quality Control elements are reported (e.g. more than one LCS), the associated samples for each element are noted in the grey shaded header line of each data table. Any Laboratory Batch, Sample Specific % recovery or RPD value that is outside the listed Acceptance Criteria is bolded in the report. In reference to questions H (CAM) or 4 (RCP) when "NO" is checked, the performance criteria for CAM and RCP methods allow for some quality control failures to occur and still be within method compliance. In these instances, the specific failure is not narrated but noted in the associated QC Outlier Summary Report, located directly after the Case Narrative. QC information is also incorporated in the Data Usability Assessment table (Format 11) of our Data Merger tool, where it can be reviewed in conjunction with the sample result, associated regulatory criteria and any associated data usability implications.

Soil/sediments and solids are reported on a dry weight basis unless otherwise noted. Tissues are reported "as received" or on a wet weight basis, unless otherwise noted. Definitions of all data qualifiers and acronyms used in this report are provided in the Glossary located at the back of the report.

HOLD POLICY - For samples submitted on hold, Pace's policy is to hold samples (with the exception of Air canisters) free of charge for 21 calendar days from the date the project is completed. After 21 calendar days, we will dispose of all samples submitted including those put on hold unless you have contacted your Pace Project Manager and made arrangements for Pace to continue to hold the samples. Air canisters will be disposed after 3 business days from the date the project is completed.

Please contact Project Management at 800-624-9220 with any questions.

Project Name:	EAST ADAMS REDEVELOP PH. VI	**Lab Number:**	L2565861
Project Number:	170859701	**Report Date:**	10/23/25

Case Narrative (continued)

Volatile Organics in Air

Canisters were released from the laboratory on October 14, 2025. The canister certification data is provided as an addendum.

L2565861-01D: The sample has elevated detection limits due to the dilution required by the elevated concentrations of target compounds in the sample.

L2565861-01D2: The sample was re-analyzed on dilution in order to quantitate the results within the calibration range. The result(s) should be considered estimated, and are qualified with an E flag, for any compound(s) that exceeded the calibration range in the initial analysis. The re-analysis was performed only for the compound(s) that exceeded the calibration range.

L2565861-02D: The sample was re-analyzed on dilution in order to quantitate the results within the calibration range. The result(s) should be considered estimated, and are qualified with an E flag, for any compound(s) that exceeded the calibration range in the initial analysis. The re-analysis was performed only for the compound(s) that exceeded the calibration range.

L2565861-02D: The canister vacuum measured on receipt at the laboratory was > 15 in. Hg. Due to the low pressure in the canister, the sample did not pull the target volume of 250 mL required for a 1X analysis. A dilution factor has been applied as a result of the lower volume analyzed.

L2565861-03D2: The sample was re-analyzed on dilution in order to quantitate the results within the calibration range. The result(s) should be considered estimated, and are qualified with an E flag, for any compound(s) that exceeded the calibration range in the initial analysis. The re-analysis was performed only for the compound(s) that exceeded the calibration range.

Project Name:	EAST ADAMS REDEVELOP PH. VI	**Lab Number:**	L2565861
Project Number:	170859701	**Report Date:**	10/23/25

Case Narrative (continued)

L2565861-03D: The sample has elevated detection limits due to the dilution required by the elevated concentrations of target compounds in the sample.

L2565861-04D: The sample was re-analyzed on dilution in order to quantitate the results within the calibration range. The result(s) should be considered estimated, and are qualified with an E flag, for any compound(s) that exceeded the calibration range in the initial analysis. The re-analysis was performed only for the compound(s) that exceeded the calibration range.

I, the undersigned, attest under the pains and penalties of perjury that, to the best of my knowledge and belief and based upon my personal inquiry of those responsible for providing the information contained in this analytical report, such information is accurate and complete. This certificate of analysis is not complete unless this page accompanies any and all pages of this report.

Authorized Signature: Christopher J. Anderson

Title: Technical Director/Representative Date: 10/23/25

AIR

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-01 D
Client ID: P6SV03_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 15:47
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil_Vapor
Anaytical Method: 48,TO-15
Analytical Date: 10/21/25 23:06
Analyst: RAY

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air - Mansfield Air Lab								
Dichlorodifluoromethane	ND	0.625	--	ND	3.09	--		3.125
Chloromethane	ND	0.625	--	ND	1.29	--		3.125
Freon-114	ND	0.625	--	ND	4.37	--		3.125
Vinyl chloride	ND	0.625	--	ND	1.60	--		3.125
1,3-Butadiene	ND	0.625	--	ND	1.38	--		3.125
Bromomethane	ND	0.625	--	ND	2.43	--		3.125
Chloroethane	ND	0.625	--	ND	1.65	--		3.125
Ethanol	ND	15.6	--	ND	29.4	--		3.125
Vinyl bromide	ND	0.625	--	ND	2.73	--		3.125
Acetone	143	3.12	--	340	7.41	--		3.125
Trichlorofluoromethane	10.5	0.625	--	59.0	3.51	--		3.125
Isopropanol	ND	3.12	--	ND	7.67	--		3.125
1,1-Dichloroethene	ND	0.625	--	ND	2.48	--		3.125
Tertiary butyl Alcohol	1.92	1.56	--	5.82	4.73	--		3.125
Methylene chloride	ND	1.56	--	ND	5.42	--		3.125
3-Chloropropene	ND	0.625	--	ND	1.96	--		3.125
Carbon disulfide	ND	0.625	--	ND	1.95	--		3.125
Freon-113	ND	0.625	--	ND	4.79	--		3.125
trans-1,2-Dichloroethene	ND	0.625	--	ND	2.48	--		3.125
1,1-Dichloroethane	ND	0.625	--	ND	2.53	--		3.125
Methyl tert butyl ether	ND	0.625	--	ND	2.25	--		3.125
2-Butanone	699	1.56	--	2060	4.60	--	E	3.125
cis-1,2-Dichloroethene	ND	0.625	--	ND	2.48	--		3.125

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-01 D
Client ID: P6SV03_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 15:47
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
Ethyl Acetate	ND	1.56	--	ND	5.62	--		3.125
Chloroform	14.2	0.625	--	69.3	3.05	--		3.125
Tetrahydrofuran	ND	1.56	--	ND	4.60	--		3.125
1,2-Dichloroethane	ND	0.625	--	ND	2.53	--		3.125
n-Hexane	3.50	0.625	--	12.3	2.20	--		3.125
1,1,1-Trichloroethane	ND	0.625	--	ND	3.41	--		3.125
Benzene	ND	0.625	--	ND	2.00	--		3.125
Carbon tetrachloride	ND	0.625	--	ND	3.93	--		3.125
Cyclohexane	ND	0.625	--	ND	2.15	--		3.125
1,2-Dichloropropane	ND	0.625	--	ND	2.89	--		3.125
Xylenes, Total	ND	0.625	--	ND	2.71	--		3.125
Bromodichloromethane	0.884	0.625	--	5.92	4.19	--		3.125
1,4-Dioxane	ND	0.625	--	ND	2.25	--		3.125
Trichloroethene	ND	0.625	--	ND	3.36	--		3.125
2,2,4-Trimethylpentane	ND	0.625	--	ND	2.92	--		3.125
Heptane	3.91	0.625	--	16.0	2.56	--		3.125
cis-1,3-Dichloropropene	ND	0.625	--	ND	2.84	--		3.125
4-Methyl-2-pentanone	ND	1.56	--	ND	6.39	--		3.125
trans-1,3-Dichloropropene	ND	0.625	--	ND	2.84	--		3.125
1,1,2-Trichloroethane	ND	0.625	--	ND	3.41	--		3.125
Toluene	ND	0.625	--	ND	2.36	--		3.125
2-Hexanone	85.2	0.625	--	349	2.56	--		3.125
Dibromochloromethane	ND	0.625	--	ND	5.32	--		3.125
1,2-Dibromoethane	ND	0.625	--	ND	4.80	--		3.125
Tetrachloroethene	ND	0.625	--	ND	4.24	--		3.125
Chlorobenzene	ND	0.625	--	ND	2.88	--		3.125

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-01 D
Client ID: P6SV03_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 15:47
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
Ethylbenzene	ND	0.625	--	ND	2.71	--		3.125
p/m-Xylene	ND	1.25	--	ND	5.43	--		3.125
Bromoform	ND	0.625	--	ND	6.46	--		3.125
Styrene	ND	0.625	--	ND	2.66	--		3.125
1,1,2,2-Tetrachloroethane	ND	0.625	--	ND	4.29	--		3.125
o-Xylene	ND	0.625	--	ND	2.71	--		3.125
4-Ethyltoluene	ND	0.625	--	ND	3.07	--		3.125
1,3,5-Trimethylbenzene	ND	0.625	--	ND	3.07	--		3.125
1,2,4-Trimethylbenzene	ND	0.625	--	ND	3.07	--		3.125
Benzyl chloride	ND	0.625	--	ND	3.24	--		3.125
1,3-Dichlorobenzene	ND	0.625	--	ND	3.76	--		3.125
1,4-Dichlorobenzene	ND	0.625	--	ND	3.76	--		3.125
1,2-Dichlorobenzene	ND	0.625	--	ND	3.76	--		3.125
1,2,4-Trichlorobenzene	ND	0.625	--	ND	4.64	--		3.125
Naphthalene	ND	0.594	--	ND	3.11	--		3.125
Hexachlorobutadiene	ND	0.625	--	ND	6.67	--		3.125

Internal Standard	% Recovery	Qualifier	Acceptance Criteria
1,4-Difluorobenzene	108		60-140
Bromochloromethane	103		60-140
chlorobenzene-d5	113		60-140

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-01 D2
Client ID: P6SV03_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 15:47
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil_Vapor
Anaytical Method: 48,TO-15
Analytical Date: 10/22/25 07:40
Analyst: RAY

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air - Mansfield Air Lab								
2-Butanone	643	8.34	--	1900	24.6	--		16.67

Internal Standard	**% Recovery**	**Qualifier**	**Acceptance Criteria**
1,4-Difluorobenzene	102		60-140
Bromochloromethane	99		60-140
chlorobenzene-d5	107		60-140

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-02 D
Client ID: P6SV02_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 16:02
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil_Vapor
Anaytical Method: 48,TO-15
Analytical Date: 10/22/25 00:02
Analyst: RAY

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air - Mansfield Air Lab								
Dichlorodifluoromethane	0.322	0.207	--	1.59	1.02	--		1.034
Chloromethane	0.296	0.207	--	0.611	0.427	--		1.034
Freon-114	ND	0.207	--	ND	1.45	--		1.034
Vinyl chloride	ND	0.207	--	ND	0.529	--		1.034
1,3-Butadiene	2.04	0.207	--	4.51	0.458	--		1.034
Bromomethane	ND	0.207	--	ND	0.804	--		1.034
Chloroethane	ND	0.207	--	ND	0.546	--		1.034
Ethanol	12.9	5.17	--	24.3	9.74	--		1.034
Vinyl bromide	ND	0.207	--	ND	0.905	--		1.034
Acetone	121	1.03	--	287	2.45	--		1.034
Trichlorofluoromethane	ND	0.207	--	ND	1.16	--		1.034
Isopropanol	3.87	1.03	--	9.51	2.53	--		1.034
1,1-Dichloroethene	ND	0.207	--	ND	0.821	--		1.034
Tertiary butyl Alcohol	1.83	0.517	--	5.55	1.57	--		1.034
Methylene chloride	ND	0.517	--	ND	1.80	--		1.034
3-Chloropropene	ND	0.207	--	ND	0.648	--		1.034
Carbon disulfide	9.12	0.207	--	28.4	0.645	--		1.034
Freon-113	ND	0.207	--	ND	1.59	--		1.034
trans-1,2-Dichloroethene	ND	0.207	--	ND	0.821	--		1.034
1,1-Dichloroethane	ND	0.207	--	ND	0.838	--		1.034
Methyl tert butyl ether	ND	0.207	--	ND	0.746	--		1.034
2-Butanone	404	0.517	--	1190	1.52	--	E	1.034
cis-1,2-Dichloroethene	ND	0.207	--	ND	0.821	--		1.034

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-02 D
Client ID: P6SV02_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 16:02
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
Ethyl Acetate	ND	0.517	--	ND	1.86	--		1.034
Chloroform	ND	0.207	--	ND	1.01	--		1.034
Tetrahydrofuran	ND	0.517	--	ND	1.52	--		1.034
1,2-Dichloroethane	ND	0.207	--	ND	0.838	--		1.034
n-Hexane	23.9	0.207	--	84.2	0.730	--		1.034
1,1,1-Trichloroethane	ND	0.207	--	ND	1.13	--		1.034
Benzene	2.14	0.207	--	6.84	0.661	--		1.034
Carbon tetrachloride	ND	0.207	--	ND	1.30	--		1.034
Cyclohexane	7.58	0.207	--	26.1	0.713	--		1.034
1,2-Dichloropropane	ND	0.207	--	ND	0.957	--		1.034
Xylenes, Total	1.61	0.207	--	6.99	0.899	--		1.034
Bromodichloromethane	ND	0.207	--	ND	1.39	--		1.034
1,4-Dioxane	ND	0.207	--	ND	0.746	--		1.034
Trichloroethene	ND	0.207	--	ND	1.11	--		1.034
2,2,4-Trimethylpentane	13.5	0.207	--	63.1	0.967	--		1.034
Heptane	13.6	0.207	--	55.7	0.848	--		1.034
cis-1,3-Dichloropropene	ND	0.207	--	ND	0.940	--		1.034
4-Methyl-2-pentanone	ND	0.517	--	ND	2.12	--		1.034
trans-1,3-Dichloropropene	ND	0.207	--	ND	0.940	--		1.034
1,1,2-Trichloroethane	ND	0.207	--	ND	1.13	--		1.034
Toluene	1.90	0.207	--	7.16	0.780	--		1.034
2-Hexanone	55.8	0.207	--	229	0.848	--		1.034
Dibromochloromethane	ND	0.207	--	ND	1.76	--		1.034
1,2-Dibromoethane	ND	0.207	--	ND	1.59	--		1.034
Tetrachloroethene	ND	0.207	--	ND	1.40	--		1.034
Chlorobenzene	ND	0.207	--	ND	0.953	--		1.034

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-02 D
Client ID: P6SV02_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 16:02
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air - Mansfield Air Lab								
Ethylbenzene	0.325	0.207	--	1.41	0.899	--		1.034
p/m-Xylene	0.921	0.414	--	4.00	1.80	--		1.034
Bromoform	ND	0.207	--	ND	2.14	--		1.034
Styrene	ND	0.207	--	ND	0.881	--		1.034
1,1,2,2-Tetrachloroethane	ND	0.207	--	ND	1.42	--		1.034
o-Xylene	0.691	0.207	--	3.00	0.899	--		1.034
4-Ethyltoluene	ND	0.207	--	ND	1.02	--		1.034
1,3,5-Trimethylbenzene	0.305	0.207	--	1.50	1.02	--		1.034
1,2,4-Trimethylbenzene	0.402	0.207	--	1.98	1.02	--		1.034
Benzyl chloride	ND	0.207	--	ND	1.07	--		1.034
1,3-Dichlorobenzene	ND	0.207	--	ND	1.24	--		1.034
1,4-Dichlorobenzene	ND	0.207	--	ND	1.24	--		1.034
1,2-Dichlorobenzene	ND	0.207	--	ND	1.24	--		1.034
1,2,4-Trichlorobenzene	ND	0.207	--	ND	1.54	--		1.034
Naphthalene	ND	0.196	--	ND	1.03	--		1.034
Hexachlorobutadiene	ND	0.207	--	ND	2.21	--		1.034

Internal Standard	**% Recovery**	**Qualifier**	**Acceptance Criteria**
1,4-Difluorobenzene	89		60-140
Bromochloromethane	88		60-140
chlorobenzene-d5	94		60-140

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-02 D
Client ID: P6SV02_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 16:02
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil_Vapor
Anaytical Method: 48,TO-15
Analytical Date: 10/22/25 08:17
Analyst: RAY

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air - Mansfield Air Lab								
2-Butanone	324	8.34	--	956	24.6	--		16.67

Internal Standard	**% Recovery**	**Qualifier**	**Acceptance Criteria**
1,4-Difluorobenzene	104		60-140
Bromochloromethane	101		60-140
chlorobenzene-d5	110		60-140

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-03 D
Client ID: P6SV10_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 16:22
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil_Vapor
Anaytical Method: 48,TO-15
Analytical Date: 10/22/25 00:39
Analyst: RAY

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air - Mansfield Air Lab								
Dichlorodifluoromethane	ND	1.00	--	ND	4.94	--		5
Chloromethane	ND	1.00	--	ND	2.07	--		5
Freon-114	ND	1.00	--	ND	6.99	--		5
Vinyl chloride	ND	1.00	--	ND	2.56	--		5
1,3-Butadiene	ND	1.00	--	ND	2.21	--		5
Bromomethane	ND	1.00	--	ND	3.88	--		5
Chloroethane	ND	1.00	--	ND	2.64	--		5
Ethanol	ND	25.0	--	ND	47.1	--		5
Vinyl bromide	ND	1.00	--	ND	4.37	--		5
Acetone	182	5.00	--	432	11.9	--		5
Trichlorofluoromethane	2.44	1.00	--	13.7	5.62	--		5
Isopropanol	5.33	5.00	--	13.1	12.3	--		5
1,1-Dichloroethene	ND	1.00	--	ND	3.96	--		5
Tertiary butyl Alcohol	ND	2.50	--	ND	7.58	--		5
Methylene chloride	ND	2.50	--	ND	8.69	--		5
3-Chloropropene	ND	1.00	--	ND	3.13	--		5
Carbon disulfide	1.62	1.00	--	5.04	3.11	--		5
Freon-113	ND	1.00	--	ND	7.66	--		5
trans-1,2-Dichloroethene	ND	1.00	--	ND	3.96	--		5
1,1-Dichloroethane	ND	1.00	--	ND	4.05	--		5
Methyl tert butyl ether	ND	1.00	--	ND	3.61	--		5
2-Butanone	888	2.50	--	2620	7.37	--	E	5
cis-1,2-Dichloroethene	ND	1.00	--	ND	3.96	--		5

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-03 D
Client ID: P6SV10_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 16:22
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
Ethyl Acetate	ND	2.50	--	ND	9.01	--		5
Chloroform	1.95	1.00	--	9.52	4.88	--		5
Tetrahydrofuran	ND	2.50	--	ND	7.37	--		5
1,2-Dichloroethane	ND	1.00	--	ND	4.05	--		5
n-Hexane	4.56	1.00	--	16.1	3.52	--		5
1,1,1-Trichloroethane	ND	1.00	--	ND	5.46	--		5
Benzene	ND	1.00	--	ND	3.19	--		5
Carbon tetrachloride	ND	1.00	--	ND	6.29	--		5
Cyclohexane	ND	1.00	--	ND	3.44	--		5
1,2-Dichloropropane	ND	1.00	--	ND	4.62	--		5
Bromodichloromethane	ND	1.00	--	ND	6.70	--		5
Xylenes, Total	ND	1.00	--	ND	4.34	--		5
1,4-Dioxane	ND	1.00	--	ND	3.60	--		5
Trichloroethene	ND	1.00	--	ND	5.37	--		5
2,2,4-Trimethylpentane	ND	1.00	--	ND	4.67	--		5
Heptane	4.12	1.00	--	16.9	4.10	--		5
cis-1,3-Dichloropropene	ND	1.00	--	ND	4.54	--		5
4-Methyl-2-pentanone	ND	2.50	--	ND	10.2	--		5
trans-1,3-Dichloropropene	ND	1.00	--	ND	4.54	--		5
1,1,2-Trichloroethane	ND	1.00	--	ND	5.46	--		5
Toluene	ND	1.00	--	ND	3.77	--		5
2-Hexanone	85.6	1.00	--	351	4.10	--		5
Dibromochloromethane	ND	1.00	--	ND	8.52	--		5
1,2-Dibromoethane	ND	1.00	--	ND	7.69	--		5
Tetrachloroethene	ND	1.00	--	ND	6.78	--		5
Chlorobenzene	ND	1.00	--	ND	4.61	--		5

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-03 D
Client ID: P6SV10_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 16:22
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
Ethylbenzene	ND	1.00	--	ND	4.34	--		5
p/m-Xylene	ND	2.00	--	ND	8.69	--		5
Bromoform	ND	1.00	--	ND	10.3	--		5
Styrene	ND	1.00	--	ND	4.26	--		5
1,1,2,2-Tetrachloroethane	ND	1.00	--	ND	6.87	--		5
o-Xylene	ND	1.00	--	ND	4.34	--		5
4-Ethyltoluene	ND	1.00	--	ND	4.92	--		5
1,3,5-Trimethylbenzene	ND	1.00	--	ND	4.92	--		5
1,2,4-Trimethylbenzene	ND	1.00	--	ND	4.92	--		5
Benzyl chloride	ND	1.00	--	ND	5.18	--		5
1,3-Dichlorobenzene	ND	1.00	--	ND	6.01	--		5
1,4-Dichlorobenzene	ND	1.00	--	ND	6.01	--		5
1,2-Dichlorobenzene	ND	1.00	--	ND	6.01	--		5
1,2,4-Trichlorobenzene	ND	1.00	--	ND	7.42	--		5
Naphthalene	ND	0.950	--	ND	4.98	--		5
Hexachlorobutadiene	ND	1.00	--	ND	10.7	--		5

Internal Standard	% Recovery	Qualifier	Acceptance Criteria
1,4-Difluorobenzene	98		60-140
Bromochloromethane	97		60-140
chlorobenzene-d5	106		60-140

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-03 D2
Client ID: P6SV10_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 16:22
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil_Vapor
Anaytical Method: 48,TO-15
Analytical Date: 10/22/25 08:54
Analyst: RAY

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air - Mansfield Air Lab								
2-Butanone	642	8.34	--	1890	24.6	--		16.67

Internal Standard	**% Recovery**	**Qualifier**	**Acceptance Criteria**
1,4-Difluorobenzene	100		60-140
Bromochloromethane	98		60-140
chlorobenzene-d5	107		60-140

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-04
Client ID: P6SV09_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 16:35
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil_Vapor
Anaytical Method: 48,TO-15
Analytical Date: 10/22/25 01:21
Analyst: RAY

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air - Mansfield Air Lab								
Dichlorodifluoromethane	0.538	0.200	--	2.66	0.989	--		1
Chloromethane	ND	0.200	--	ND	0.413	--		1
Freon-114	ND	0.200	--	ND	1.40	--		1
Vinyl chloride	ND	0.200	--	ND	0.511	--		1
1,3-Butadiene	ND	0.200	--	ND	0.442	--		1
Bromomethane	ND	0.200	--	ND	0.777	--		1
Chloroethane	ND	0.200	--	ND	0.528	--		1
Ethanol	14.8	5.00	--	27.9	9.42	--		1
Vinyl bromide	ND	0.200	--	ND	0.874	--		1
Acetone	177	1.00	--	420	2.38	--		1
Trichlorofluoromethane	20.4	0.200	--	115	1.12	--		1
Isopropanol	4.45	1.00	--	10.9	2.46	--		1
1,1-Dichloroethene	ND	0.200	--	ND	0.793	--		1
Tertiary butyl Alcohol	2.22	0.500	--	6.73	1.52	--		1
Methylene chloride	ND	0.500	--	ND	1.74	--		1
3-Chloropropene	ND	0.200	--	ND	0.626	--		1
Carbon disulfide	0.487	0.200	--	1.52	0.623	--		1
Freon-113	ND	0.200	--	ND	1.53	--		1
trans-1,2-Dichloroethene	ND	0.200	--	ND	0.793	--		1
1,1-Dichloroethane	ND	0.200	--	ND	0.809	--		1
Methyl tert butyl ether	ND	0.200	--	ND	0.721	--		1
2-Butanone	529	0.500	--	1560	1.47	--	E	1
cis-1,2-Dichloroethene	ND	0.200	--	ND	0.793	--		1

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-04
Client ID: P6SV09_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 16:35
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
Ethyl Acetate	ND	0.500	--	ND	1.80	--		1
Chloroform	ND	0.200	--	ND	0.977	--		1
Tetrahydrofuran	ND	0.500	--	ND	1.47	--		1
1,2-Dichloroethane	ND	0.200	--	ND	0.809	--		1
n-Hexane	3.68	0.200	--	13.0	0.705	--		1
1,1,1-Trichloroethane	ND	0.200	--	ND	1.09	--		1
Benzene	0.436	0.200	--	1.39	0.639	--		1
Carbon tetrachloride	ND	0.200	--	ND	1.26	--		1
Cyclohexane	ND	0.200	--	ND	0.688	--		1
1,2-Dichloropropane	ND	0.200	--	ND	0.924	--		1
Xylenes, Total	ND	0.200	--	ND	0.869	--		1
Bromodichloromethane	ND	0.200	--	ND	1.34	--		1
1,4-Dioxane	ND	0.200	--	ND	0.721	--		1
Trichloroethene	ND	0.200	--	ND	1.07	--		1
2,2,4-Trimethylpentane	ND	0.200	--	ND	0.934	--		1
Heptane	3.67	0.200	--	15.0	0.820	--		1
cis-1,3-Dichloropropene	ND	0.200	--	ND	0.908	--		1
4-Methyl-2-pentanone	ND	0.500	--	ND	2.05	--		1
trans-1,3-Dichloropropene	ND	0.200	--	ND	0.908	--		1
1,1,2-Trichloroethane	ND	0.200	--	ND	1.09	--		1
Toluene	0.476	0.200	--	1.79	0.754	--		1
2-Hexanone	88.5	0.200	--	363	0.820	--		1
Dibromochloromethane	ND	0.200	--	ND	1.70	--		1
1,2-Dibromoethane	ND	0.200	--	ND	1.54	--		1
Tetrachloroethene	ND	0.200	--	ND	1.36	--		1
Chlorobenzene	ND	0.200	--	ND	0.921	--		1

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-04
Client ID: P6SV09_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 16:35
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
Ethylbenzene	ND	0.200	--	ND	0.869	--		1
p/m-Xylene	ND	0.400	--	ND	1.74	--		1
Bromoform	ND	0.200	--	ND	2.07	--		1
Styrene	ND	0.200	--	ND	0.852	--		1
1,1,2,2-Tetrachloroethane	ND	0.200	--	ND	1.37	--		1
o-Xylene	ND	0.200	--	ND	0.869	--		1
4-Ethyltoluene	ND	0.200	--	ND	0.983	--		1
1,3,5-Trimethylbenzene	ND	0.200	--	ND	0.983	--		1
1,2,4-Trimethylbenzene	ND	0.200	--	ND	0.983	--		1
Benzyl chloride	ND	0.200	--	ND	1.04	--		1
1,3-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
1,4-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
1,2-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
1,2,4-Trichlorobenzene	ND	0.200	--	ND	1.48	--		1
Naphthalene	ND	0.190	--	ND	0.996	--		1
Hexachlorobutadiene	ND	0.200	--	ND	2.13	--		1

Internal Standard	% Recovery	Qualifier	Acceptance Criteria
1,4-Difluorobenzene	92		60-140
Bromochloromethane	89		60-140
chlorobenzene-d5	96		60-140

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-04 D
Client ID: P6SV09_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 16:35
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Soil_Vapor
Anaytical Method: 48,TO-15
Analytical Date: 10/22/25 09:32
Analyst: RAY

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air - Mansfield Air Lab								
2-Butanone	836	8.34	--	2470	24.6	--		16.67

Internal Standard	**% Recovery**	**Qualifier**	**Acceptance Criteria**
1,4-Difluorobenzene	93		60-140
Bromochloromethane	90		60-140
chlorobenzene-d5	97		60-140

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-05
Client ID: P6AA01_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 15:57
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:
Matrix: Air
Anaytical Method: 48,TO-15
Analytical Date: 10/21/25 18:44
Analyst: RAY

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air - Mansfield Air Lab								
Dichlorodifluoromethane	0.541	0.200	--	2.68	0.989	--		1
Chloromethane	0.506	0.200	--	1.04	0.413	--		1
Freon-114	ND	0.200	--	ND	1.40	--		1
Vinyl chloride	ND	0.200	--	ND	0.511	--		1
1,3-Butadiene	ND	0.200	--	ND	0.442	--		1
Bromomethane	ND	0.200	--	ND	0.777	--		1
Chloroethane	ND	0.200	--	ND	0.528	--		1
Ethanol	ND	5.00	--	ND	9.42	--		1
Vinyl bromide	ND	0.200	--	ND	0.874	--		1
Acetone	2.16	1.00	--	5.13	2.38	--		1
Trichlorofluoromethane	0.246	0.200	--	1.38	1.12	--		1
Isopropanol	1.06	1.00	--	2.61	2.46	--		1
1,1-Dichloroethene	ND	0.200	--	ND	0.793	--		1
Tertiary butyl Alcohol	ND	0.500	--	ND	1.52	--		1
Methylene chloride	ND	0.500	--	ND	1.74	--		1
3-Chloropropene	ND	0.200	--	ND	0.626	--		1
Carbon disulfide	ND	0.200	--	ND	0.623	--		1
Freon-113	ND	0.200	--	ND	1.53	--		1
trans-1,2-Dichloroethene	ND	0.200	--	ND	0.793	--		1
1,1-Dichloroethane	ND	0.200	--	ND	0.809	--		1
Methyl tert butyl ether	ND	0.200	--	ND	0.721	--		1
2-Butanone	ND	0.500	--	ND	1.47	--		1
cis-1,2-Dichloroethene	ND	0.200	--	ND	0.793	--		1

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-05
Client ID: P6AA01_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 15:57
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
Ethyl Acetate	ND	0.500	--	ND	1.80	--		1
Chloroform	ND	0.200	--	ND	0.977	--		1
Tetrahydrofuran	ND	0.500	--	ND	1.47	--		1
1,2-Dichloroethane	ND	0.200	--	ND	0.809	--		1
n-Hexane	ND	0.200	--	ND	0.705	--		1
1,1,1-Trichloroethane	ND	0.200	--	ND	1.09	--		1
Benzene	ND	0.200	--	ND	0.639	--		1
Carbon tetrachloride	ND	0.200	--	ND	1.26	--		1
Cyclohexane	ND	0.200	--	ND	0.688	--		1
1,2-Dichloropropane	ND	0.200	--	ND	0.924	--		1
Xylenes, Total	ND	0.200	--	ND	0.869	--		1
Bromodichloromethane	ND	0.200	--	ND	1.34	--		1
1,4-Dioxane	ND	0.200	--	ND	0.721	--		1
Trichloroethene	ND	0.200	--	ND	1.07	--		1
2,2,4-Trimethylpentane	ND	0.200	--	ND	0.934	--		1
Heptane	ND	0.200	--	ND	0.820	--		1
cis-1,3-Dichloropropene	ND	0.200	--	ND	0.908	--		1
4-Methyl-2-pentanone	ND	0.500	--	ND	2.05	--		1
trans-1,3-Dichloropropene	ND	0.200	--	ND	0.908	--		1
1,1,2-Trichloroethane	ND	0.200	--	ND	1.09	--		1
Toluene	ND	0.200	--	ND	0.754	--		1
2-Hexanone	ND	0.200	--	ND	0.820	--		1
Dibromochloromethane	ND	0.200	--	ND	1.70	--		1
1,2-Dibromoethane	ND	0.200	--	ND	1.54	--		1
Tetrachloroethene	ND	0.200	--	ND	1.36	--		1
Chlorobenzene	ND	0.200	--	ND	0.921	--		1

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701
Lab Number: L2565861
Report Date: 10/23/25

SAMPLE RESULTS

Lab ID: L2565861-05
Client ID: P6AA01_101625
Sample Location: SYRACUSE, NY

Date Collected: 10/16/25 15:57
Date Received: 10/16/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
Ethylbenzene	ND	0.200	--	ND	0.869	--		1
p/m-Xylene	ND	0.400	--	ND	1.74	--		1
Bromoform	ND	0.200	--	ND	2.07	--		1
Styrene	ND	0.200	--	ND	0.852	--		1
1,1,2,2-Tetrachloroethane	ND	0.200	--	ND	1.37	--		1
o-Xylene	ND	0.200	--	ND	0.869	--		1
4-Ethyltoluene	ND	0.200	--	ND	0.983	--		1
1,3,5-Trimethylbenzene	ND	0.200	--	ND	0.983	--		1
1,2,4-Trimethylbenzene	ND	0.200	--	ND	0.983	--		1
Benzyl chloride	ND	0.200	--	ND	1.04	--		1
1,3-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
1,4-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
1,2-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
1,2,4-Trichlorobenzene	ND	0.200	--	ND	1.48	--		1
Naphthalene	ND	0.190	--	ND	0.996	--		1
Hexachlorobutadiene	ND	0.200	--	ND	2.13	--		1

Internal Standard	% Recovery	Qualifier	Acceptance Criteria
1,4-Difluorobenzene	83		60-140
Bromochloromethane	83		60-140
chlorobenzene-d5	86		60-140

Project Name: EAST ADAMS REDEVELOP PH. VI **Lab Number:** L2565861

Project Number: 170859701 **Report Date:** 10/23/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 48,TO-15
Analytical Date: 10/21/25 17:22

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab for sample(s): 01-05 Batch: WG2130838-4								
Dichlorodifluoromethane	ND	0.200	--	ND	0.989	--		1
Chloromethane	ND	0.200	--	ND	0.413	--		1
Freon-114	ND	0.200	--	ND	1.40	--		1
Vinyl chloride	ND	0.200	--	ND	0.511	--		1
1,3-Butadiene	ND	0.200	--	ND	0.442	--		1
Bromomethane	ND	0.200	--	ND	0.777	--		1
Chloroethane	ND	0.200	--	ND	0.528	--		1
Ethanol	ND	5.00	--	ND	9.42	--		1
Vinyl bromide	ND	0.200	--	ND	0.874	--		1
Acetone	ND	1.00	--	ND	2.38	--		1
Trichlorofluoromethane	ND	0.200	--	ND	1.12	--		1
Isopropanol	ND	1.00	--	ND	2.46	--		1
1,1-Dichloroethene	ND	0.200	--	ND	0.793	--		1
Tertiary butyl Alcohol	ND	0.500	--	ND	1.52	--		1
Methylene chloride	ND	0.500	--	ND	1.74	--		1
3-Chloropropene	ND	0.200	--	ND	0.626	--		1
Carbon disulfide	ND	0.200	--	ND	0.623	--		1
Freon-113	ND	0.200	--	ND	1.53	--		1
trans-1,2-Dichloroethene	ND	0.200	--	ND	0.793	--		1
1,1-Dichloroethane	ND	0.200	--	ND	0.809	--		1
Methyl tert butyl ether	ND	0.200	--	ND	0.721	--		1
Xylenes, Total	ND	0.200	--	ND	0.869	--		1
2-Butanone	ND	0.500	--	ND	1.47	--		1
cis-1,2-Dichloroethene	ND	0.200	--	ND	0.793	--		1
Ethyl Acetate	ND	0.500	--	ND	1.80	--		1

Project Name: EAST ADAMS REDEVELOP PH. VI **Lab Number:** L2565861

Project Number: 170859701 **Report Date:** 10/23/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 48,TO-15
Analytical Date: 10/21/25 17:22

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab for sample(s): 01-05 Batch: WG2130838-4								
Chloroform	ND	0.200	--	ND	0.977	--		1
Tetrahydrofuran	ND	0.500	--	ND	1.47	--		1
1,2-Dichloroethane	ND	0.200	--	ND	0.809	--		1
n-Hexane	ND	0.200	--	ND	0.705	--		1
1,1,1-Trichloroethane	ND	0.200	--	ND	1.09	--		1
Benzene	ND	0.200	--	ND	0.639	--		1
Carbon tetrachloride	ND	0.200	--	ND	1.26	--		1
Cyclohexane	ND	0.200	--	ND	0.688	--		1
1,2-Dichloropropane	ND	0.200	--	ND	0.924	--		1
Bromodichloromethane	ND	0.200	--	ND	1.34	--		1
1,4-Dioxane	ND	0.200	--	ND	0.721	--		1
Trichloroethene	ND	0.200	--	ND	1.07	--		1
2,2,4-Trimethylpentane	ND	0.200	--	ND	0.934	--		1
Heptane	ND	0.200	--	ND	0.820	--		1
cis-1,3-Dichloropropene	ND	0.200	--	ND	0.908	--		1
4-Methyl-2-pentanone	ND	0.500	--	ND	2.05	--		1
trans-1,3-Dichloropropene	ND	0.200	--	ND	0.908	--		1
1,1,2-Trichloroethane	ND	0.200	--	ND	1.09	--		1
Toluene	ND	0.200	--	ND	0.754	--		1
2-Hexanone	ND	0.200	--	ND	0.820	--		1
Dibromochloromethane	ND	0.200	--	ND	1.70	--		1
1,2-Dibromoethane	ND	0.200	--	ND	1.54	--		1
Tetrachloroethene	ND	0.200	--	ND	1.36	--		1
Chlorobenzene	ND	0.200	--	ND	0.921	--		1
Ethylbenzene	ND	0.200	--	ND	0.869	--		1

Project Name: EAST ADAMS REDEVELOP PH. VI **Lab Number:** L2565861

Project Number: 170859701 **Report Date:** 10/23/25

Method Blank Analysis
Batch Quality Control

Analytical Method: 48,TO-15
Analytical Date: 10/21/25 17:22

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab for sample(s): 01-05 Batch: WG2130838-4								
p/m-Xylene	ND	0.400	--	ND	1.74	--		1
Bromoform	ND	0.200	--	ND	2.07	--		1
Styrene	ND	0.200	--	ND	0.852	--		1
1,1,2,2-Tetrachloroethane	ND	0.200	--	ND	1.37	--		1
o-Xylene	ND	0.200	--	ND	0.869	--		1
4-Ethyltoluene	ND	0.200	--	ND	0.983	--		1
1,3,5-Trimethylbenzene	ND	0.200	--	ND	0.983	--		1
1,2,4-Trimethylbenzene	ND	0.200	--	ND	0.983	--		1
Benzyl chloride	ND	0.200	--	ND	1.04	--		1
1,3-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
1,4-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
1,2-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
1,2,4-Trichlorobenzene	ND	0.200	--	ND	1.48	--		1
Naphthalene	ND	0.190	--	ND	0.996	--		1
Hexachlorobutadiene	ND	0.200	--	ND	2.13	--		1

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701

Lab Number: L2565861
Report Date: 10/23/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics in Air - Mansfield Air Lab	Associated sample(s): 01-05		Batch: WG2130838-3					
Dichlorodifluoromethane	101		-		70-130	-		
Chloromethane	91		-		70-130	-		
Freon-114	114		-		70-130	-		
Vinyl chloride	104		-		70-130	-		
1,3-Butadiene	97		-		70-130	-		
Bromomethane	114		-		70-130	-		
Chloroethane	110		-		70-130	-		
Ethanol	74		-		40-160	-		
Vinyl bromide	98		-		70-130	-		
Acetone	90		-		40-160	-		
Trichlorofluoromethane	102		-		70-130	-		
Isopropanol	86		-		40-160	-		
1,1-Dichloroethene	110		-		70-130	-		
Tertiary butyl Alcohol	86		-		70-130	-		
Methylene chloride	100		-		70-130	-		
3-Chloropropene	108		-		70-130	-		
Carbon disulfide	100		-		70-130	-		
Freon-113	109		-		70-130	-		
trans-1,2-Dichloroethene	109		-		70-130	-		

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701

Lab Number: L2565861
Report Date: 10/23/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics in Air - Mansfield Air Lab Associated sample(s): 01-05 Batch: WG2130838-3								
1,1-Dichloroethane	109		-		70-130	-		
Methyl tert butyl ether	99		-		70-130	-		
2-Butanone	105		-		70-130	-		
cis-1,2-Dichloroethene	109		-		70-130	-		
Ethyl Acetate	113		-		70-130	-		
Chloroform	103		-		70-130	-		
Tetrahydrofuran	113		-		70-130	-		
1,2-Dichloroethane	103		-		70-130	-		
n-Hexane	105		-		70-130	-		
1,1,1-Trichloroethane	103		-		70-130	-		
Benzene	100		-		70-130	-		
Carbon tetrachloride	103		-		70-130	-		
Cyclohexane	106		-		70-130	-		
1,2-Dichloropropane	111		-		70-130	-		
Bromodichloromethane	108		-		70-130	-		
1,4-Dioxane	99		-		70-130	-		
Trichloroethene	108		-		70-130	-		
2,2,4-Trimethylpentane	110		-		70-130	-		
Heptane	110		-		70-130	-		

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701

Lab Number: L2565861
Report Date: 10/23/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics in Air - Mansfield Air Lab Associated sample(s): 01-05 Batch: WG2130838-3								
cis-1,3-Dichloropropene	111		-		70-130	-		
4-Methyl-2-pentanone	104		-		70-130	-		
trans-1,3-Dichloropropene	118		-		70-130	-		
1,1,2-Trichloroethane	108		-		70-130	-		
Toluene	111		-		70-130	-		
2-Hexanone	106		-		70-130	-		
Dibromochloromethane	117		-		70-130	-		
1,2-Dibromoethane	114		-		70-130	-		
Tetrachloroethene	108		-		70-130	-		
Chlorobenzene	108		-		70-130	-		
Ethylbenzene	110		-		70-130	-		
p/m-Xylene	111		-		70-130	-		
Bromoform	117		-		70-130	-		
Styrene	110		-		70-130	-		
1,1,2,2-Tetrachloroethane	112		-		70-130	-		
o-Xylene	114		-		70-130	-		
4-Ethyltoluene	109		-		70-130	-		
1,3,5-Trimethylbenzene	113		-		70-130	-		
1,2,4-Trimethylbenzene	111		-		70-130	-		

Lab Control Sample Analysis
Batch Quality Control

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701

Lab Number: L2565861
Report Date: 10/23/25

Parameter	LCS %Recovery	Qual	LCSD %Recovery	Qual	%Recovery Limits	RPD	Qual	RPD Limits
Volatile Organics in Air - Mansfield Air Lab	Associated sample(s): 01-05		Batch: WG2130838-3					
Benzyl chloride	86		-		70-130	-		
1,3-Dichlorobenzene	112		-		70-130	-		
1,4-Dichlorobenzene	111		-		70-130	-		
1,2-Dichlorobenzene	109		-		70-130	-		
1,2,4-Trichlorobenzene	112		-		70-130	-		
Naphthalene	94		-		70-130	-		
Hexachlorobutadiene	106		-		70-130	-		

Project Name: EAST ADAMS REDEVELOP PH. VI

Lab Number: L2565861

Project Number: 170859701

Report Date: 10/23/25

Canister and Flow Controller Information

Samplenum	Client ID	Media ID	Media Type	Date Prepared	Bottle Order	Cleaning Batch ID	Can Leak Check	Initial Pressure (in. Hg)	Pressure on Receipt	Flow Controler Leak Chk	Flow Out mL/min	Flow In	% RPD
L2565861-01	P6SV03_101625	03094	Flow 2	10/14/25	539455		-	-	-	Pass	40.0	41.4	3
L2565861-01	P6SV03_101625	4276	6.0L Can	10/14/25	539455	L2562820-01	Pass	-29.4	-5.2	-	-	-	-
L2565861-02	P6SV02_101625	03095	Flow 2	10/14/25	539455		-	-	-	Pass	40.3	43.0	6
L2565861-02	P6SV02_101625	2316	6.0L Can	10/14/25	539455	L2562820-01	Pass	-29.3	-4.2	-	-	-	-
L2565861-03	P6SV10_101625	01499	Flow 2	10/14/25	539458		-	-	-	Pass	40.0	41.2	3
L2565861-03	P6SV10_101625	1663	6.0L Can	10/14/25	539458	L2562820-03	Pass	-29.5	-4.5	-	-	-	-
L2565861-04	P6SV09_101625	01603	Flow 2	10/14/25	539455		-	-	-	Pass	40.0	40.7	2
L2565861-04	P6SV09_101625	3363	6.0L Can	10/14/25	539455	L2562820-01	Pass	-29.4	-4.6	-	-	-	-
L2565861-05	P6AA01_101625	02008	Flow 2	10/14/25	539455		-	-	-	Pass	40.5	42.5	5
L2565861-05	P6AA01_101625	4301	6.0L Can	10/14/25	539455	L2562820-01	Pass	-29.4	-4.2	-	-	-	-

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT
Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-01
Client ID: CAN 1558 SHELF 117
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:
Matrix: Air
Anaytical Method: 48,TO-15
Analytical Date: 10/06/25 21:29
Analyst: KMH

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air - Mansfield Air Lab								
Chlorodifluoromethane	ND	0.200	--	ND	0.707	--		1
Propylene	ND	0.500	--	ND	0.861	--		1
Propane	ND	0.500	--	ND	0.902	--		1
Dichlorodifluoromethane	ND	0.200	--	ND	0.989	--		1
Chloromethane	ND	0.200	--	ND	0.413	--		1
Freon-114	ND	0.200	--	ND	1.40	--		1
Methanol	ND	5.00	--	ND	6.55	--		1
Vinyl chloride	ND	0.200	--	ND	0.511	--		1
1,3-Butadiene	ND	0.200	--	ND	0.442	--		1
Butane	ND	0.200	--	ND	0.475	--		1
Bromomethane	ND	0.200	--	ND	0.777	--		1
Chloroethane	ND	0.200	--	ND	0.528	--		1
Ethanol	ND	5.00	--	ND	9.42	--		1
Dichlorofluoromethane	ND	0.200	--	ND	0.842	--		1
Vinyl bromide	ND	0.200	--	ND	0.874	--		1
Acrolein	ND	0.500	--	ND	1.15	--		1
Acetone	ND	1.00	--	ND	2.38	--		1
Acetonitrile	ND	0.200	--	ND	0.336	--		1
Trichlorofluoromethane	ND	0.200	--	ND	1.12	--		1
Isopropanol	ND	1.00	--	ND	2.46	--		1
Acrylonitrile	ND	0.500	--	ND	1.09	--		1
Pentane	ND	0.200	--	ND	0.590	--		1
Ethyl ether	ND	0.200	--	ND	0.606	--		1
1,1-Dichloroethene	ND	0.200	--	ND	0.793	--		1

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT
Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-01
Client ID: CAN 1558 SHELF 117
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
Tertiary butyl Alcohol	ND	0.500	--	ND	1.52	--		1
Methylene chloride	ND	0.500	--	ND	1.74	--		1
3-Chloropropene	ND	0.200	--	ND	0.626	--		1
Carbon disulfide	ND	0.200	--	ND	0.623	--		1
Freon-113	ND	0.200	--	ND	1.53	--		1
trans-1,2-Dichloroethene	ND	0.200	--	ND	0.793	--		1
1,1-Dichloroethane	ND	0.200	--	ND	0.809	--		1
Methyl tert butyl ether	ND	0.200	--	ND	0.721	--		1
Vinyl acetate	ND	1.00	--	ND	3.52	--		1
Xylenes, total	ND	0.600	--	ND	0.869	--		1
2-Butanone	ND	0.500	--	ND	1.47	--		1
cis-1,2-Dichloroethene	ND	0.200	--	ND	0.793	--		1
Ethyl Acetate	ND	0.500	--	ND	1.80	--		1
Chloroform	ND	0.200	--	ND	0.977	--		1
Tetrahydrofuran	ND	0.500	--	ND	1.47	--		1
2,2-Dichloropropane	ND	0.200	--	ND	0.924	--		1
1,2-Dichloroethane	ND	0.200	--	ND	0.809	--		1
n-Hexane	ND	0.200	--	ND	0.705	--		1
Diisopropyl ether	ND	0.200	--	ND	0.836	--		1
tert-Butyl Ethyl Ether	ND	0.200	--	ND	0.836	--		1
1,2-Dichloroethene (total)	ND	1.00	--	ND	1.00	--		1
1,1,1-Trichloroethane	ND	0.200	--	ND	1.09	--		1
1,1-Dichloropropene	ND	0.200	--	ND	0.908	--		1
Benzene	ND	0.200	--	ND	0.639	--		1
Carbon tetrachloride	ND	0.200	--	ND	1.26	--		1
Cyclohexane	ND	0.200	--	ND	0.688	--		1
tert-Amyl Methyl Ether	ND	0.200	--	ND	0.836	--		1

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT
Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-01
Client ID: CAN 1558 SHELF 117
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
Dibromomethane	ND	0.200	--	ND	1.42	--		1
1,2-Dichloropropane	ND	0.200	--	ND	0.924	--		1
Bromodichloromethane	ND	0.200	--	ND	1.34	--		1
1,4-Dioxane	ND	0.200	--	ND	0.721	--		1
Trichloroethene	ND	0.200	--	ND	1.07	--		1
2,2,4-Trimethylpentane	ND	0.200	--	ND	0.934	--		1
Methyl Methacrylate	ND	0.500	--	ND	2.05	--		1
Heptane	ND	0.200	--	ND	0.820	--		1
cis-1,3-Dichloropropene	ND	0.200	--	ND	0.908	--		1
4-Methyl-2-pentanone	ND	0.500	--	ND	2.05	--		1
trans-1,3-Dichloropropene	ND	0.200	--	ND	0.908	--		1
1,1,2-Trichloroethane	ND	0.200	--	ND	1.09	--		1
Toluene	ND	0.200	--	ND	0.754	--		1
1,3-Dichloropropane	ND	0.200	--	ND	0.924	--		1
2-Hexanone	ND	0.200	--	ND	0.820	--		1
Dibromochloromethane	ND	0.200	--	ND	1.70	--		1
1,2-Dibromoethane	ND	0.200	--	ND	1.54	--		1
Butyl acetate	ND	0.500	--	ND	2.38	--		1
Octane	ND	0.200	--	ND	0.934	--		1
Tetrachloroethene	ND	0.200	--	ND	1.36	--		1
1,1,1,2-Tetrachloroethane	ND	0.200	--	ND	1.37	--		1
Chlorobenzene	ND	0.200	--	ND	0.921	--		1
Ethylbenzene	ND	0.200	--	ND	0.869	--		1
p/m-Xylene	ND	0.400	--	ND	1.74	--		1
Bromoform	ND	0.200	--	ND	2.07	--		1
Styrene	ND	0.200	--	ND	0.852	--		1
1,1,2,2-Tetrachloroethane	ND	0.200	--	ND	1.37	--		1

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT
Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-01
Client ID: CAN 1558 SHELF 117
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
o-Xylene	ND	0.200	--	ND	0.869	--		1
1,2,3-Trichloropropane	ND	0.200	--	ND	1.21	--		1
Nonane	ND	0.200	--	ND	1.05	--		1
Isopropylbenzene	ND	0.200	--	ND	0.983	--		1
Bromobenzene	ND	0.200	--	ND	0.793	--		1
2-Chlorotoluene	ND	0.200	--	ND	1.04	--		1
n-Propylbenzene	ND	0.200	--	ND	0.983	--		1
4-Chlorotoluene	ND	0.200	--	ND	1.04	--		1
4-Ethyltoluene	ND	0.200	--	ND	0.983	--		1
1,3,5-Trimethylbenzene	ND	0.200	--	ND	0.983	--		1
tert-Butylbenzene	ND	0.200	--	ND	1.10	--		1
1,2,4-Trimethylbenzene	ND	0.200	--	ND	0.983	--		1
Decane	ND	0.200	--	ND	1.16	--		1
Benzyl chloride	ND	0.200	--	ND	1.04	--		1
1,3-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
1,4-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
sec-Butylbenzene	ND	0.200	--	ND	1.10	--		1
p-Isopropyltoluene	ND	0.200	--	ND	1.10	--		1
1,2-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
n-Butylbenzene	ND	0.200	--	ND	1.10	--		1
1,2-Dibromo-3-chloropropane	ND	0.200	--	ND	1.93	--		1
Undecane	ND	0.200	--	ND	1.28	--		1
Dodecane	ND	0.200	--	ND	1.39	--		1
1,2,4-Trichlorobenzene	ND	0.200	--	ND	1.48	--		1
Naphthalene	ND	0.200	--	ND	0.996	--		1
1,2,3-Trichlorobenzene	ND	0.200	--	ND	1.48	--		1
Hexachlorobutadiene	ND	0.200	--	ND	2.13	--		1

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT
Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-01
Client ID: CAN 1558 SHELF 117
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								

	Results	Qualifier	Units	RDL	Dilution Factor
Tentatively Identified Compounds					

No Tentatively Identified Compounds

Internal Standard	% Recovery	Qualifier	Acceptance Criteria
1,4-Difluorobenzene	77		60-140
Bromochloromethane	93		60-140
chlorobenzene-d5	75		60-140

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT
Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-01
Client ID: CAN 1558 SHELF 117
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:
Matrix: Air
Anaytical Method: 48,TO-15-SIM
Analytical Date: 10/06/25 21:29
Analyst: KMH

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air by SIM - Mansfield Air Lab								
Dichlorodifluoromethane	ND	0.200	--	ND	0.989	--		1
Chloromethane	ND	0.200	--	ND	0.413	--		1
Freon-114	ND	0.050	--	ND	0.349	--		1
Vinyl chloride	ND	0.020	--	ND	0.051	--		1
1,3-Butadiene	ND	0.020	--	ND	0.044	--		1
Bromomethane	ND	0.020	--	ND	0.078	--		1
Chloroethane	ND	0.100	--	ND	0.264	--		1
Acrolein	ND	0.050	--	ND	0.115	--		1
Acetone	ND	1.00	--	ND	2.38	--		1
Trichlorofluoromethane	ND	0.050	--	ND	0.281	--		1
Acrylonitrile	ND	0.500	--	ND	1.09	--		1
1,1-Dichloroethene	ND	0.020	--	ND	0.079	--		1
Methylene chloride	ND	0.500	--	ND	1.74	--		1
Freon-113	ND	0.050	--	ND	0.383	--		1
trans-1,2-Dichloroethene	ND	0.020	--	ND	0.079	--		1
1,1-Dichloroethane	ND	0.020	--	ND	0.081	--		1
Methyl tert butyl ether	ND	0.200	--	ND	0.721	--		1
2-Butanone	ND	0.500	--	ND	1.47	--		1
cis-1,2-Dichloroethene	ND	0.020	--	ND	0.079	--		1
Chloroform	ND	0.020	--	ND	0.098	--		1
1,2-Dichloroethane	ND	0.020	--	ND	0.081	--		1
1,1,1-Trichloroethane	ND	0.020	--	ND	0.109	--		1
Benzene	ND	0.100	--	ND	0.319	--		1
Carbon tetrachloride	ND	0.020	--	ND	0.126	--		1

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT

Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-01
Client ID: CAN 1558 SHELF 117
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air by SIM - Mansfield Air Lab								
1,2-Dichloropropane	ND	0.020	--	ND	0.092	--		1
Bromodichloromethane	ND	0.020	--	ND	0.134	--		1
1,4-Dioxane	ND	0.100	--	ND	0.360	--		1
Trichloroethene	ND	0.020	--	ND	0.107	--		1
cis-1,3-Dichloropropene	ND	0.020	--	ND	0.091	--		1
4-Methyl-2-pentanone	ND	0.500	--	ND	2.05	--		1
trans-1,3-Dichloropropene	ND	0.020	--	ND	0.091	--		1
1,1,2-Trichloroethane	ND	0.020	--	ND	0.109	--		1
Toluene	ND	0.100	--	ND	0.377	--		1
Dibromochloromethane	ND	0.020	--	ND	0.170	--		1
1,2-Dibromoethane	ND	0.020	--	ND	0.154	--		1
Tetrachloroethene	ND	0.020	--	ND	0.136	--		1
1,1,1,2-Tetrachloroethane	ND	0.020	--	ND	0.137	--		1
Chlorobenzene	ND	0.100	--	ND	0.461	--		1
Ethylbenzene	ND	0.020	--	ND	0.087	--		1
p/m-Xylene	ND	0.040	--	ND	0.174	--		1
Bromoform	ND	0.020	--	ND	0.207	--		1
Styrene	ND	0.020	--	ND	0.085	--		1
1,1,2,2-Tetrachloroethane	ND	0.020	--	ND	0.137	--		1
o-Xylene	ND	0.020	--	ND	0.087	--		1
Isopropylbenzene	ND	0.200	--	ND	0.983	--		1
4-Ethyltoluene	ND	0.020	--	ND	0.098	--		1
1,3,5-Trimethybenzene	ND	0.020	--	ND	0.098	--		1
1,2,4-Trimethylbenzene	ND	0.020	--	ND	0.098	--		1
Benzyl chloride	ND	0.100	--	ND	0.518	--		1
1,3-Dichlorobenzene	ND	0.020	--	ND	0.120	--		1
1,4-Dichlorobenzene	ND	0.020	--	ND	0.120	--		1

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT
Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-01
Client ID: CAN 1558 SHELF 117
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air by SIM - Mansfield Air Lab								
sec-Butylbenzene	ND	0.200	--	ND	1.10	--		1
p-Isopropyltoluene	ND	0.200	--	ND	1.10	--		1
1,2-Dichlorobenzene	ND	0.020	--	ND	0.120	--		1
n-Butylbenzene	ND	0.200	--	ND	1.10	--		1
1,2,4-Trichlorobenzene	ND	0.050	--	ND	0.371	--		1
Naphthalene	ND	0.050	--	ND	0.262	--		1
1,2,3-Trichlorobenzene	ND	0.050	--	ND	0.371	--		1
Hexachlorobutadiene	ND	0.050	--	ND	0.533	--		1

Internal Standard	% Recovery	Qualifier	Acceptance Criteria
1,4-difluorobenzene	81		60-140
bromochloromethane	96		60-140
chlorobenzene-d5	81		60-140

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT

Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-03
Client ID: CAN 5520 SHELF 121
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:
Matrix: Air
Anaytical Method: 48,TO-15
Analytical Date: 10/06/25 22:44
Analyst: KMH

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air - Mansfield Air Lab								
Chlorodifluoromethane	ND	0.200	--	ND	0.707	--		1
Propylene	ND	0.500	--	ND	0.861	--		1
Propane	ND	0.500	--	ND	0.902	--		1
Dichlorodifluoromethane	ND	0.200	--	ND	0.989	--		1
Chloromethane	ND	0.200	--	ND	0.413	--		1
Freon-114	ND	0.200	--	ND	1.40	--		1
Methanol	ND	5.00	--	ND	6.55	--		1
Vinyl chloride	ND	0.200	--	ND	0.511	--		1
1,3-Butadiene	ND	0.200	--	ND	0.442	--		1
Butane	ND	0.200	--	ND	0.475	--		1
Bromomethane	ND	0.200	--	ND	0.777	--		1
Chloroethane	ND	0.200	--	ND	0.528	--		1
Ethanol	ND	5.00	--	ND	9.42	--		1
Dichlorofluoromethane	ND	0.200	--	ND	0.842	--		1
Vinyl bromide	ND	0.200	--	ND	0.874	--		1
Acrolein	ND	0.500	--	ND	1.15	--		1
Acetone	ND	1.00	--	ND	2.38	--		1
Acetonitrile	ND	0.200	--	ND	0.336	--		1
Trichlorofluoromethane	ND	0.200	--	ND	1.12	--		1
Isopropanol	ND	1.00	--	ND	2.46	--		1
Acrylonitrile	ND	0.500	--	ND	1.09	--		1
Pentane	ND	0.200	--	ND	0.590	--		1
Ethyl ether	ND	0.200	--	ND	0.606	--		1
1,1-Dichloroethene	ND	0.200	--	ND	0.793	--		1

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT
Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-03
Client ID: CAN 5520 SHELF 121
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
Tertiary butyl Alcohol	ND	0.500	--	ND	1.52	--		1
Methylene chloride	ND	0.500	--	ND	1.74	--		1
3-Chloropropene	ND	0.200	--	ND	0.626	--		1
Carbon disulfide	ND	0.200	--	ND	0.623	--		1
Freon-113	ND	0.200	--	ND	1.53	--		1
trans-1,2-Dichloroethene	ND	0.200	--	ND	0.793	--		1
1,1-Dichloroethane	ND	0.200	--	ND	0.809	--		1
Methyl tert butyl ether	ND	0.200	--	ND	0.721	--		1
Vinyl acetate	ND	1.00	--	ND	3.52	--		1
Xylenes, total	ND	0.600	--	ND	0.869	--		1
2-Butanone	ND	0.500	--	ND	1.47	--		1
cis-1,2-Dichloroethene	ND	0.200	--	ND	0.793	--		1
Ethyl Acetate	ND	0.500	--	ND	1.80	--		1
Chloroform	ND	0.200	--	ND	0.977	--		1
Tetrahydrofuran	ND	0.500	--	ND	1.47	--		1
2,2-Dichloropropane	ND	0.200	--	ND	0.924	--		1
1,2-Dichloroethane	ND	0.200	--	ND	0.809	--		1
n-Hexane	ND	0.200	--	ND	0.705	--		1
Diisopropyl ether	ND	0.200	--	ND	0.836	--		1
tert-Butyl Ethyl Ether	ND	0.200	--	ND	0.836	--		1
1,2-Dichloroethene (total)	ND	1.00	--	ND	1.00	--		1
1,1,1-Trichloroethane	ND	0.200	--	ND	1.09	--		1
1,1-Dichloropropene	ND	0.200	--	ND	0.908	--		1
Benzene	ND	0.200	--	ND	0.639	--		1
Carbon tetrachloride	ND	0.200	--	ND	1.26	--		1
Cyclohexane	ND	0.200	--	ND	0.688	--		1
tert-Amyl Methyl Ether	ND	0.200	--	ND	0.836	--		1

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT
Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-03
Client ID: CAN 5520 SHELF 121
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
Dibromomethane	ND	0.200	--	ND	1.42	--		1
1,2-Dichloropropane	ND	0.200	--	ND	0.924	--		1
Bromodichloromethane	ND	0.200	--	ND	1.34	--		1
1,4-Dioxane	ND	0.200	--	ND	0.721	--		1
Trichloroethene	ND	0.200	--	ND	1.07	--		1
2,2,4-Trimethylpentane	ND	0.200	--	ND	0.934	--		1
Methyl Methacrylate	ND	0.500	--	ND	2.05	--		1
Heptane	ND	0.200	--	ND	0.820	--		1
cis-1,3-Dichloropropene	ND	0.200	--	ND	0.908	--		1
4-Methyl-2-pentanone	ND	0.500	--	ND	2.05	--		1
trans-1,3-Dichloropropene	ND	0.200	--	ND	0.908	--		1
1,1,2-Trichloroethane	ND	0.200	--	ND	1.09	--		1
Toluene	ND	0.200	--	ND	0.754	--		1
1,3-Dichloropropane	ND	0.200	--	ND	0.924	--		1
2-Hexanone	ND	0.200	--	ND	0.820	--		1
Dibromochloromethane	ND	0.200	--	ND	1.70	--		1
1,2-Dibromoethane	ND	0.200	--	ND	1.54	--		1
Butyl acetate	ND	0.500	--	ND	2.38	--		1
Octane	ND	0.200	--	ND	0.934	--		1
Tetrachloroethene	ND	0.200	--	ND	1.36	--		1
1,1,1,2-Tetrachloroethane	ND	0.200	--	ND	1.37	--		1
Chlorobenzene	ND	0.200	--	ND	0.921	--		1
Ethylbenzene	ND	0.200	--	ND	0.869	--		1
p/m-Xylene	ND	0.400	--	ND	1.74	--		1
Bromoform	ND	0.200	--	ND	2.07	--		1
Styrene	ND	0.200	--	ND	0.852	--		1
1,1,2,2-Tetrachloroethane	ND	0.200	--	ND	1.37	--		1

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT
Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-03
Client ID: CAN 5520 SHELF 121
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								
o-Xylene	ND	0.200	--	ND	0.869	--		1
1,2,3-Trichloropropane	ND	0.200	--	ND	1.21	--		1
Nonane	ND	0.200	--	ND	1.05	--		1
Isopropylbenzene	ND	0.200	--	ND	0.983	--		1
Bromobenzene	ND	0.200	--	ND	0.793	--		1
2-Chlorotoluene	ND	0.200	--	ND	1.04	--		1
n-Propylbenzene	ND	0.200	--	ND	0.983	--		1
4-Chlorotoluene	ND	0.200	--	ND	1.04	--		1
4-Ethyltoluene	ND	0.200	--	ND	0.983	--		1
1,3,5-Trimethylbenzene	ND	0.200	--	ND	0.983	--		1
tert-Butylbenzene	ND	0.200	--	ND	1.10	--		1
1,2,4-Trimethylbenzene	ND	0.200	--	ND	0.983	--		1
Decane	ND	0.200	--	ND	1.16	--		1
Benzyl chloride	ND	0.200	--	ND	1.04	--		1
1,3-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
1,4-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
sec-Butylbenzene	ND	0.200	--	ND	1.10	--		1
p-Isopropyltoluene	ND	0.200	--	ND	1.10	--		1
1,2-Dichlorobenzene	ND	0.200	--	ND	1.20	--		1
n-Butylbenzene	ND	0.200	--	ND	1.10	--		1
1,2-Dibromo-3-chloropropane	ND	0.200	--	ND	1.93	--		1
Undecane	ND	0.200	--	ND	1.28	--		1
Dodecane	ND	0.200	--	ND	1.39	--		1
1,2,4-Trichlorobenzene	ND	0.200	--	ND	1.48	--		1
Naphthalene	ND	0.200	--	ND	0.996	--		1
1,2,3-Trichlorobenzene	ND	0.200	--	ND	1.48	--		1
Hexachlorobutadiene	ND	0.200	--	ND	2.13	--		1

Project Name: BATCH CANISTER CERTIFICATION **Lab Number:** L2562820

Project Number: CANISTER QC BAT **Report Date:** 10/23/25

Air Canister Certification Results

Lab ID: L2562820-03
Client ID: CAN 5520 SHELF 121
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air - Mansfield Air Lab								

	Results	Qualifier	Units	RDL	Dilution Factor
Tentatively Identified Compounds					

No Tentatively Identified Compounds

Internal Standard	% Recovery	Qualifier	Acceptance Criteria
1,4-Difluorobenzene	73		60-140
Bromochloromethane	90		60-140
chlorobenzene-d5	74		60-140

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT
Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-03
Client ID: CAN 5520 SHELF 121
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:
Matrix: Air
Anaytical Method: 48,TO-15-SIM
Analytical Date: 10/06/25 22:44
Analyst: KMH

	ppbV			ug/m3				
Parameter	**Results**	**RL**	**MDL**	**Results**	**RL**	**MDL**	**Qualifier**	**Dilution Factor**
Volatile Organics in Air by SIM - Mansfield Air Lab								
Dichlorodifluoromethane	ND	0.200	--	ND	0.989	--		1
Chloromethane	ND	0.200	--	ND	0.413	--		1
Freon-114	ND	0.050	--	ND	0.349	--		1
Vinyl chloride	ND	0.020	--	ND	0.051	--		1
1,3-Butadiene	ND	0.020	--	ND	0.044	--		1
Bromomethane	ND	0.020	--	ND	0.078	--		1
Chloroethane	ND	0.100	--	ND	0.264	--		1
Acrolein	ND	0.050	--	ND	0.115	--		1
Acetone	ND	1.00	--	ND	2.38	--		1
Trichlorofluoromethane	ND	0.050	--	ND	0.281	--		1
Acrylonitrile	ND	0.500	--	ND	1.09	--		1
1,1-Dichloroethene	ND	0.020	--	ND	0.079	--		1
Methylene chloride	ND	0.500	--	ND	1.74	--		1
Freon-113	ND	0.050	--	ND	0.383	--		1
trans-1,2-Dichloroethene	ND	0.020	--	ND	0.079	--		1
1,1-Dichloroethane	ND	0.020	--	ND	0.081	--		1
Methyl tert butyl ether	ND	0.200	--	ND	0.721	--		1
2-Butanone	ND	0.500	--	ND	1.47	--		1
cis-1,2-Dichloroethene	ND	0.020	--	ND	0.079	--		1
Chloroform	ND	0.020	--	ND	0.098	--		1
1,2-Dichloroethane	ND	0.020	--	ND	0.081	--		1
1,1,1-Trichloroethane	ND	0.020	--	ND	0.109	--		1
Benzene	ND	0.100	--	ND	0.319	--		1
Carbon tetrachloride	ND	0.020	--	ND	0.126	--		1

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT
Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-03
Client ID: CAN 5520 SHELF 121
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air by SIM - Mansfield Air Lab								
1,2-Dichloropropane	ND	0.020	--	ND	0.092	--		1
Bromodichloromethane	ND	0.020	--	ND	0.134	--		1
1,4-Dioxane	ND	0.100	--	ND	0.360	--		1
Trichloroethene	ND	0.020	--	ND	0.107	--		1
cis-1,3-Dichloropropene	ND	0.020	--	ND	0.091	--		1
4-Methyl-2-pentanone	ND	0.500	--	ND	2.05	--		1
trans-1,3-Dichloropropene	ND	0.020	--	ND	0.091	--		1
1,1,2-Trichloroethane	ND	0.020	--	ND	0.109	--		1
Toluene	ND	0.100	--	ND	0.377	--		1
Dibromochloromethane	ND	0.020	--	ND	0.170	--		1
1,2-Dibromoethane	ND	0.020	--	ND	0.154	--		1
Tetrachloroethene	ND	0.020	--	ND	0.136	--		1
1,1,1,2-Tetrachloroethane	ND	0.020	--	ND	0.137	--		1
Chlorobenzene	ND	0.100	--	ND	0.461	--		1
Ethylbenzene	ND	0.020	--	ND	0.087	--		1
p/m-Xylene	ND	0.040	--	ND	0.174	--		1
Bromoform	ND	0.020	--	ND	0.207	--		1
Styrene	ND	0.020	--	ND	0.085	--		1
1,1,2,2-Tetrachloroethane	ND	0.020	--	ND	0.137	--		1
o-Xylene	ND	0.020	--	ND	0.087	--		1
Isopropylbenzene	ND	0.200	--	ND	0.983	--		1
4-Ethyltoluene	ND	0.020	--	ND	0.098	--		1
1,3,5-Trimethybenzene	ND	0.020	--	ND	0.098	--		1
1,2,4-Trimethylbenzene	ND	0.020	--	ND	0.098	--		1
Benzyl chloride	ND	0.100	--	ND	0.518	--		1
1,3-Dichlorobenzene	ND	0.020	--	ND	0.120	--		1
1,4-Dichlorobenzene	ND	0.020	--	ND	0.120	--		1

Project Name: BATCH CANISTER CERTIFICATION
Project Number: CANISTER QC BAT
Lab Number: L2562820
Report Date: 10/23/25

Air Canister Certification Results

Lab ID: L2562820-03
Client ID: CAN 5520 SHELF 121
Sample Location:

Date Collected: 10/04/25 12:00
Date Received: 10/06/25
Field Prep: Not Specified

Sample Depth:

Parameter	ppbV Results	ppbV RL	ppbV MDL	ug/m3 Results	ug/m3 RL	ug/m3 MDL	Qualifier	Dilution Factor
Volatile Organics in Air by SIM - Mansfield Air Lab								
sec-Butylbenzene	ND	0.200	--	ND	1.10	--		1
p-Isopropyltoluene	ND	0.200	--	ND	1.10	--		1
1,2-Dichlorobenzene	ND	0.020	--	ND	0.120	--		1
n-Butylbenzene	ND	0.200	--	ND	1.10	--		1
1,2,4-Trichlorobenzene	ND	0.050	--	ND	0.371	--		1
Naphthalene	ND	0.050	--	ND	0.262	--		1
1,2,3-Trichlorobenzene	ND	0.050	--	ND	0.371	--		1
Hexachlorobutadiene	ND	0.050	--	ND	0.533	--		1

Internal Standard	% Recovery	Qualifier	Acceptance Criteria
1,4-difluorobenzene	77		60-140
bromochloromethane	94		60-140
chlorobenzene-d5	79		60-140

Project Name: EAST ADAMS REDEVELOP PH. VI
Project Number: 170859701

Lab Number: L2565861
Report Date: 10/23/25

Sample Receipt and Container Information

Were project specific reporting limits specified? YES

Cooler Information

Cooler	Custody Seal
NA	Absent

Container Information

Container ID	Container Type	Cooler	Initial pH	Final pH	Temp deg C	Pres	Seal	Frozen Date/Time	Analysis(*)
L2565861-01A	Canister - 6L (Batch Certified)	NA	NA			Y	Absent		TO15-LL(30)
L2565861-02A	Canister - 6L (Batch Certified)	NA	NA			Y	Absent		TO15-LL(30)
L2565861-03A	Canister - 6L (Batch Certified)	NA	NA			Y	Absent		TO15-LL(30)
L2565861-04A	Canister - 6L (Batch Certified)	NA	NA			Y	Absent		TO15-LL(30)
L2565861-05A	Canister - 6L (Batch Certified)	NA	NA			Y	Absent		TO15-LL(30)

*Values in parentheses indicate holding time in days

Project Name:	EAST ADAMS REDEVELOP PH. VI	**Lab Number:**	L2565861
Project Number:	170859701	**Report Date:**	10/23/25

GLOSSARY

Acronyms

DL - Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the limit of quantitation (LOQ). The DL includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)

EDL - Estimated Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the reporting limit (RL). The EDL includes any adjustments from dilutions, concentrations or moisture content, where applicable. The use of EDLs is specific to the analysis of PAHs using Solid-Phase Microextraction (SPME).

EMPC - Estimated Maximum Possible Concentration: The concentration that results from the signal present at the retention time of an analyte when the ions meet all of the identification criteria except the ion abundance ratio criteria. An EMPC is a worst-case estimate of the concentration.

EPA - Environmental Protection Agency.

LCS - Laboratory Control Sample: A sample matrix, free from the analytes of interest, spiked with verified known amounts of analytes or a material containing known and verified amounts of analytes.

LCSD - Laboratory Control Sample Duplicate: Refer to LCS.

LFB - Laboratory Fortified Blank: A sample matrix, free from the analytes of interest, spiked with verified known amounts of analytes or a material containing known and verified amounts of analytes.

LOD - Limit of Detection: This value represents the level to which a target analyte can reliably be detected for a specific analyte in a specific matrix by a specific method. The LOD includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)

LOQ - Limit of Quantitation: The value at which an instrument can accurately measure an analyte at a specific concentration. The LOQ includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)

Limit of Quantitation: The value at which an instrument can accurately measure an analyte at a specific concentration. The LOQ includes any adjustments from dilutions, concentrations or moisture content, where applicable. (DoD report formats only.)

MDL - Method Detection Limit: This value represents the level to which target analyte concentrations are reported as estimated values, when those target analyte concentrations are quantified below the reporting limit (RL). The MDL includes any adjustments from dilutions, concentrations or moisture content, where applicable.

MS - Matrix Spike Sample: A sample prepared by adding a known mass of target analyte to a specified amount of matrix sample for which an independent estimate of target analyte concentration is available. For Method 332.0, the spike recovery is calculated using the native concentration, including estimated values.

MSD - Matrix Spike Sample Duplicate: Refer to MS.

NA - Not Applicable.

NC - Not Calculated: Term is utilized when one or more of the results utilized in the calculation are non-detect at the parameter's reporting unit.

NDPA/DPA - N-Nitrosodiphenylamine/Diphenylamine.

NI - Not Ignitable.

NP - Non-Plastic: Term is utilized for the analysis of Atterberg Limits in soil.

NR - No Results: Term is utilized when 'No Target Compounds Requested' is reported for the analysis of Volatile or Semivolatile Organic TIC only requests.

RL - Reporting Limit: The value at which an instrument can accurately measure an analyte at a specific concentration. The RL includes any adjustments from dilutions, concentrations or moisture content, where applicable.

RPD - Relative Percent Difference: The results from matrix and/or matrix spike duplicates are primarily designed to assess the precision of analytical results in a given matrix and are expressed as relative percent difference (RPD). Values which are less than five times the reporting limit for any individual parameter are evaluated by utilizing the absolute difference between the values; although the RPD value will be provided in the report.

SRM - Standard Reference Material: A reference sample of a known or certified value that is of the same or similar matrix as the associated field samples.

STLP - Semi-dynamic Tank Leaching Procedure per EPA Method 1315.

TEF - Toxic Equivalency Factors: The values assigned to each dioxin and furan to evaluate their toxicity relative to 2,3,7,8-TCDD.

TEQ - Toxic Equivalent: The measure of a sample's toxicity derived by multiplying each dioxin and furan by its corresponding TEF and then summing the resulting values.

TIC - Tentatively Identified Compound: A compound that has been identified to be present and is not part of the target compound list (TCL) for the method and/or program. All TICs are qualitatively identified and reported as estimated concentrations.

Report Format: Data Usability Report

Project Name:	EAST ADAMS REDEVELOP PH. VI	**Lab Number:**	L2565861
Project Number:	170859701	**Report Date:**	10/23/25

Footnotes

1 - The reference for this analyte should be considered modified since this analyte is absent from the target analyte list of the original method.

Terms

Analytical Method: Both the document from which the method originates and the analytical reference method. (Example: EPA 8260B is shown as 1,8260B.) The codes for the reference method documents are provided in the References section of the Addendum.

Chlordane: The target compound Chlordane (CAS No. 57-74-9) is reported for GC ECD analyses. Per EPA,this compound "refers to a mixture of chlordane isomers, other chlorinated hydrocarbons and numerous other components." (Reference: USEPA Toxicological Review of Chlordane, In Support of Summary Information on the Integrated Risk Information System (IRIS), December 1997.)

Difference: With respect to Total Oxidizable Precursor (TOP) Assay analysis, the difference is defined as the Post-Treatment value minus the Pre-Treatment value.

Final pH: As it pertains to Sample Receipt & Container Information section of the report, Final pH reflects pH of container determined after adjustment at the laboratory, if applicable. If no adjustment required, value reflects Initial pH.

Frozen Date/Time: With respect to Volatile Organics in soil, Frozen Date/Time reflects the date/time at which associated Reagent Water-preserved vials were initially frozen. Note: If frozen date/time is beyond 48 hours from sample collection, value will be reflected in 'bold'.

Gasoline Range Organics (GRO): Gasoline Range Organics (GRO) results include all chromatographic peaks eluting from Methyl tert butyl ether through Naphthalene, with the exception of GRO analysis in support of State of Ohio programs, which includes all chromatographic peaks eluting from Hexane through Dodecane.

Initial pH: As it pertains to Sample Receipt & Container Information section of the report, Initial pH reflects pH of container determined upon receipt, if applicable.

PAH Total: With respect to Alkylated PAH analyses, the 'PAHs, Total' result is defined as the summation of results for all or a subset of the following compounds: Naphthalene, C1-C4 Naphthalenes, 2-Methylnaphthalene, 1-Methylnaphthalene, Biphenyl, Acenaphthylene, Acenaphthene, Fluorene, C1-C3 Fluorenes, Phenanthrene, C1-C4 Phenanthrenes/Anthracenes, Anthracene, Fluoranthene, Pyrene, C1-C4 Fluoranthenes/Pyrenes, Benz(a)anthracene, Chrysene, C1-C4 Chrysenes, Benzo(b)fluoranthene, Benzo(j)+(k)fluoranthene, Benzo(e)pyrene, Benzo(a)pyrene, Perylene, Indeno(1,2,3-cd)pyrene, Dibenz(ah)+(ac)anthracene, Benzo(g,h,i)perylene. If a 'Total' result is requested, the results of its individual components will also be reported.

PFAS Total: With respect to PFAS analyses, the 'PFAS, Total (5)' result is defined as the summation of results for: PFHpA, PFHxS, PFOA, PFNA and PFOS. In addition, the 'PFAS, Total (6)' result is defined as the summation of results for: PFHpA, PFHxS, PFOA, PFNA, PFDA and PFOS. For MassDEP DW compliance analysis only, the 'PFAS, Total (6)' result is defined as the summation of results at or above the RL. Note: If a 'Total' result is requested, the results of its individual components will also be reported.

Total: With respect to Organic analyses, a 'Total' result is defined as the summation of results for individual isomers or Aroclors. If a 'Total' result is requested, the results of its individual components will also be reported. This is applicable to 'Total' results for methods 8260, 8081 and 8082.

Data Qualifiers

A - Spectra identified as "Aldol Condensates" are byproducts of the extraction/concentration procedures when acetone is introduced in the process.

B - The analyte was detected above the reporting limit in the associated method blank. Flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank. For MCP-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank. For DOD-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte at less than ten times (10x) the concentration found in the blank AND the analyte was detected above one-half the reporting limit (or above the reporting limit for common lab contaminants) in the associated method blank. For NJ-Air-related projects, flag only applies to associated field samples that have detectable concentrations of the analyte above the reporting limit. For NJ-related projects (excluding Air), flag only applies to associated field samples that have detectable concentrations of the analyte, which was detected above the reporting limit in the associated method blank or above five times the reporting limit for common lab contaminants (Phthalates, Acetone, Methylene Chloride, 2-Butanone).

C - Co-elution: The target analyte co-elutes with a known lab standard (i.e. surrogate, internal standards, etc.) for co-extracted analyses.

D - Concentration of analyte was quantified from diluted analysis. Flag only applies to field samples that have detectable concentrations of the analyte.

E - Concentration of analyte exceeds the range of the calibration curve and/or linear range of the instrument.

F - The ratio of quantifier ion response to qualifier ion response falls outside of the laboratory criteria. Results are considered to be an estimated maximum concentration.

G - The concentration may be biased high due to matrix interferences (i.e, co-elution) with non-target compound(s). The result should be considered estimated.

H - The analysis of pH was performed beyond the regulatory-required holding time of 15 minutes from the time of sample collection.

I - The lower value for the two columns has been reported due to obvious interference.

J - Estimated value. This represents an estimated concentration for Tentatively Identified Compounds (TICs).

M - Reporting Limit (RL) exceeds the MCP CAM Reporting Limit for this analyte.

Report Format: Data Usability Report

Project Name:	EAST ADAMS REDEVELOP PH. VI	**Lab Number:**	L2565861
Project Number:	170859701	**Report Date:**	10/23/25

Data Qualifiers

ND	- Not detected at the reporting limit (RL) for the sample.
NJ	- Presumptive evidence of compound. This represents an estimated concentration for Tentatively Identified Compounds (TICs), where the identification is based on a mass spectral library search.
P	- The RPD between the results for the two columns exceeds the method-specified criteria.
Q	- The quality control sample exceeds the associated acceptance criteria. For DOD-related projects, LCS and/or Continuing Calibration Standard exceedences are also qualified on all associated sample results. Note: This flag is not applicable for matrix spike recoveries when the sample concentration is greater than 4x the spike added or for batch duplicate RPD when the sample concentrations are less than 5x the RL. (Metals only.)
R	- Analytical results are from sample re-analysis.
RE	- Analytical results are from sample re-extraction.
S	- Analytical results are from modified screening analysis.
V	- The surrogate associated with this target analyte has a recovery outside the QC acceptance limits. (Applicable to MassDEP DW Compliance samples only.)
Z	- The batch matrix spike and/or duplicate associated with this target analyte has a recovery/RPD outside the QC acceptance limits. (Applicable to MassDEP DW Compliance samples only.)

Project Name: EAST ADAMS REDEVELOP PH. VI **Lab Number:** L2565861

Project Number: 170859701 **Report Date:** 10/23/25

REFERENCES

48 Compendium of Methods for the Determination of Toxic Organic Compounds in Ambient Air. Second Edition. EPA/625/R-96/010b, January 1999.

LIMITATION OF LIABILITIES

Pace Analytical Services performs services with reasonable care and diligence normal to the analytical testing laboratory industry. In the event of an error, the sole and exclusive responsibility of Pace Analytical Services shall be to re-perform the work at it's own expense. In no event shall Pace Analytical Services be held liable for any incidental, consequential or special damages, including but not limited to, damages in any way connected with the use of, interpretation of, information or analysis provided by Pace Analytical Services.

We strongly urge our clients to comply with EPA protocol regarding sample volume, preservation, cooling, containers, sampling procedures, holding time and splitting of samples in the field.

Certification Information

The following analytes are not included in our Primary NELAP Scope of Accreditation:

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581
EPA 624.1: m/p-xylene, o-xylene, Naphthalene
EPA 625.1: alpha-Terpineol
EPA 8260D: NPW: 1,2,4,5-Tetramethylbenzene; 4-Ethyltoluene; SCM: Iodomethane (methyl iodide), 1,2,4,5-Tetramethylbenzene; 4-Ethyltoluene.
EPA 8270E: NPW: Dimethylnaphthalene,1,4-Diphenylhydrazine, alpha-Terpineol, Azobenzene; SCM: Dimethylnaphthalene,1,4-Diphenylhydrazine.
SM4500: NPW: Amenable Cyanide; SCM: Total Phosphorus, TKN, NO2, NO3.

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
SM 2540D: TSS.
EPA TO-15: Halothane, 2,4,4-Trimethyl-2-pentene, 2,4,4-Trimethyl-1-pentene, Thiophene, 2-Methylthiophene, 3-Methylthiophene, 2-Ethylthiophene, 1,2,3-Trimethylbenzene, Indan, Indene, 1,2,4,5-Tetramethylbenzene, Benzothiophene, 1-Methylnaphthalene.
MADEP-APH.
Nonpotable Water: EPA RSK-175 Dissolved Gases
Biological Tissue Matrix: EPA 3050B

Mansfield Facility – 120 Forbes Blvd. Mansfield, MA 02048
EPA TO-15: Halothane, 2,4,4-Trimethyl-2-pentene, 2,4,4-Trimethyl-1-pentene, Thiophene, 2-Methylthiophene, 3-Methylthiophene, 2-Ethylthiophene, 1,2,3-Trimethylbenzene, Indan, Indene, 1,2,4,5-Tetramethylbenzene, Benzothiophene, 1-Methylnaphthalene.
Nonpotable Water: EPA RSK-175 Dissolved Gases

The following test method is not included in our New Jersey Secondary NELAP Scope of Accreditation:

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
Determination of Selected Perfluorinated Alkyl Substances by Solid Phase Extraction and Liquid Chromatography/Tandem Mass Spectrometry Isotope Dilution (via Alpha SOP 23528)

The following analytes are included in our Massachusetts DEP Scope of Accreditation

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581

Drinking Water
EPA 300.0: Chloride, Nitrate-N, Fluoride, Sulfate; **EPA 353.2**: Nitrate-N, Nitrite-N; **SM4500NO3-F**: Nitrate-N, Nitrite-N; **SM4500F-C, SM4500CN-CE, EPA 180.1, SM2130B, SM4500Cl-D, SM2320B, SM2540C, SM4500H-B, SM4500NO2-B**
EPA 524.2: THMs and VOCs; **EPA 504.1:** EDB, DBCP.
Microbiology: **SM9215B; SM9223-P/A, SM9223B-Colilert-QT,SM9222D**.

Non-Potable Water
SM4500H,B, EPA 120.1, SM2510B, SM2540C, SM2320B, SM4500CL-E, SM4500F-BC, SM4500NH3-BH: Ammonia-N and Kjeldahl-N, **EPA 350.1**: Ammonia-N, **LACHAT 10-107-06-1-B**: Ammonia-N, **EPA 351.1, SM4500NO3-F, EPA 353.2**: Nitrate-N**, SM4500P-E, SM4500P-B, E, SM4500SO4-E, SM5220D, EPA 410.4, SM5210B, SM5310C, SM4500CL-D, SM4500CL-G, EPA 1664, EPA 420.1, SM4500-CN-CE, SM2540D, EPA 300: Chloride, Sulfate, Nitrate.**
EPA 624.1: Volatile Halocarbons & Aromatics,
EPA 608.3: Chlordane, Toxaphene, Aldrin, alpha-BHC, beta-BHC, gamma-BHC, delta-BHC, Dieldrin, DDD, DDE, DDT, Endosulfan I, Endosulfan II, Endosulfan sulfate, Endrin, Endrin Aldehyde, Heptachlor, Heptachlor Epoxide, PCBs
EPA 625.1: SVOC (Acid/Base/Neutral Extractables).
Microbiology: **SM9223B-Colilert-QT; Enterolert-QT.**

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048

Drinking Water
EPA 200.7: Al, Ba, Cd, Cr, Cu, Fe, Mn, Ni, Na, Ag, Ca, Zn. **EPA 200.8:** Al, Sb, As, Ba, Be, Cd, Cr, Cu, Pb, Mn, Ni, Se, Ag, TL, Zn. **EPA 245.1** Hg.
EPA 522, EPA 537.1.

Non-Potable Water
EPA 200.7: Al, Sb, As, Be, Cd, Ca, Cr, Co, Cu, Fe, Pb, Mg, Mn, Mo, Ni, K, Se, Ag, Na, Sr, TL, Ti, V, Zn.
EPA 200.8: Al, Sb**,** As, Be, Cd, Ca, Cr, Cu, Fe, Pb, Mg, Mn, Ni, K, Se, Ag, Na, TL, Zn.
EPA 245.1: Hg. **EPA 245.7:** Hg.
SM2340B

Certification IDs:

Westborough Facility – 8 Walkup Dr. Westborough, MA 01581
CT PH-0826, IL 200077, IN C-MA-03, KY kY98045, ME MA00086, MD 348, MA M-MA086, NH 2064, NJ MA935, NY 11148, NC (DW) 25700, NC (NPW/SCM) 666, OR MA-1316, PA 68-03671, RI LAO00065, TX T104704476, VT VT-0935, VA 460195

Mansfield Facility – 320 Forbes Blvd. Mansfield, MA 02048
MA M-MA00030, CT PH-0825, ANAB/DoD L2474, IL 200081, IN C-MA-04, KY KY98046, LA 85084, ME MA00030, MI 9110, MN 025-999-495, NH 2062, NJ MA015, NY 11627, NC (NPW/SCM) 685, OR MA-0262, PA 68-02089, RI LAO00299, TX T-104704419, VT VT-0015, VA 460194, WA C954

Mansfield Facility – 120 Forbes Blvd. Mansfield, MA 02048
ANAB/DoD L2474, LA 245052, ME MA01156, MN 025-999-498, NH 2249, NJ MA025, NY 12191, OR 4203, TX T104704583, VA 460311, WA C1104.

For a complete listing of analytes and methods, please contact your Project Manager.

AIR ANALYSIS

Pace ANALYTICAL SERVICES — CHAIN OF CUSTODY

PAGE 1 OF 1

120 Forbes Blvd, Mansfield, MA 02048
TEL: 508-822-9300 FAX: 508-822-3288

Date Rec'd in Lab: 10/17/25

Pace® Job #: L2565861

Client Information

Client: Langan Engineering
Address: 368 9th Ave 8th Fl
New York, NY 10001
Phone: 212-479-5402
Fax: N/A
Email: LHaley@langan.com
☐ These samples have been previously analyzed by Pace

Project Information

Project Name: East Adams Redev. Phase VI
Project Location: Syracuse, NY
Project #: 170859701
Project Manager: Lexi Haley
Pace® Quote #: 26297

Turn-Around Time

☒ Standard ☐ RUSH (only confirmed if pre-approved!)
Date Due: Time:

Report Information - Data Deliverables

☐ FAX
☐ ADEx
Criteria Checker:
(Default based on Regulatory Criteria Indicated)
Other Formats:
☒ EMAIL (standard pdf report)
☒ Additional Deliverables: ASP-A
Report to: (if different than Project Manager)

Billing Information

☒ Same as Client info PO #:
cc ksemon, edivando, datamanagement@langan.com.

Regulatory Requirements/Report Limits

State/Fed	Program	Res / Comm
NY	Part 375	

Other Project Specific Requirements/Comments:

Project-Specific Target Compound List: ☐

All Columns Below Must Be Filled Out

PACE Lab ID (Lab Use Only)	Sample ID	COLLECTION End Date	Start Time	End Time	Initial Vacuum	Final Vacuum	Sample Matrix*	Sampler's Initials	Can Size	ID Can	ID - Flow Controller	TO-15	TO-15 SIM	APH (subset Non-petroleum HCs ☐)	Fixed Gases	Sulfides & Mercaptans by TO-15	Sample Comments (i.e. PID)
65861-01	P6SV03_101625	10/16/25	1346	1547	29.3	5.80	SV	AMB	AB 6	4276	03094	X					
-02	P6SV02_101625		1400	1602	29.87	5.22		AMB		2316	03075	X					
-03	P6SV10_101625		1416	1622	29.89	5.60		AMB		1663	01499	X					
-04	P6SV09_101625		1432	1635	30.00	5.78		AMB		3363	01603	X					
-05	P6AA01_101625		1400	1557	30.00	5.22	AA	AMB		4301	02008	X					

*SAMPLE MATRIX CODES
AA = Ambient Air (Indoor/Outdoor)
SV = Soil Vapor/Landfill Gas/SVE
Other = Please Specify

Container Type

Please print clearly, legibly and completely. Samples can not be logged in and turnaround time clock will not start until any ambi-guities are resolved. All samples submitted are subject to Pace's Terms and Conditions. See reverse side.

Relinquished By:	Date/Time	Received By:	Date/Time:
Langan	10/16/25 1658		
	10/16/25 1740		10-16-25 17:58
	10/16/25		10/16/25 2300
	10/17/25 0330		

10/17/25 0530

Sample Delivery Group Summary

Pace Job Number : L2565861

Account Name : Langan Engineering & Environmental
Project Number : 170859701
Project Name : EAST ADAMS REDEVELOP PH. VI

Received : 16-OCT-2025
Reviewer : Christopher J Anderson

Delivery Information

Samples Delivered By : Pace Courier

Chain of Custody : Present

Cooler Information

Cooler	Seal/Seal#	Preservation	Temperature(°C)	Additional Information
NA	Absent/			

Condition Information

1) All samples on COC received?	**YES**
2) Extra samples received?	**NO**
3) Are there any sample container discrepancies?	**NO**
4) Are there any discrepancies between COC & sample labels?	**NO**
5) Are samples in appropriate containers for requested analysis?	**YES**
6) Are samples properly preserved for requested analysis?	**YES**
7) Are samples within holding time for requested analysis?	**YES**
8) All sampling equipment returned?	**YES**

Volatile Organics/VPH

1) Reagent Water Vials Frozen by Client?	**NA**