DAILY FIELD REPORT

Project	291 Wallabout Street Site	**Report No.**	50
BCP Site	NYSDEC BCP SITE C224416	**Date**	08/26/2026
Location	291 Wallabout St	**File No.**	0211139
Client	291 Wallabout Realty LLC	**Temperature**	L: 65 H: 81
Contractor	Concrete Raptor Construction American Dewatering Grouting	**Wind Direction**	NW to SE up to 14 mph
Weather	Sunny	**Personnel on Site**	B. Chan
Humidity	60%	**Time on Site**	7:00am – 6:30pm

Haley & Aldrich of New York (Haley & Aldrich) was present to document implementation of the NYSDEC-Approved Remedial Action Work Plan (RAWP) and Decision Document dated November 2025. Site observations are summarized below.

Daily Observations:

- Continued work on foundation elements.
- Installation of lagging in the eastern part of the site.

Waste Disposal/Material Import Tracking:

Material Export:

Soil/Fill Material is summarized below

Disposal Facility	*Bayshore Soil Management, LLC* *Keasbey, New Jersey*		*Conestoga Landfill* *Morgantown, Pennsylvania*		*Posillico Materials, LLC* *Farmingdale, New York*		*Republic Environmental Systems (PA), LLC* *Hatfield, Pennsylvania*		*P Park NJ* *Prospect Park, New Jersey*		*Total*	
	Loads	Tons	Loads	Tons	Loads	Tons	Loads	Tons	Loads	Tons	Loads	Tons
Today:	0	0	0	0	0	0	0	0	0	0	0	0
Total:	34	680	5	100	3	60	1	20	32	640	75	1500

C&D export is summarized below

	Facility: Morrisville Materials, Morrisville, PA (C&D disposal)	
Today:	0 Loads	0 CY
Total:	19 Loads	380 CY

Material Import:

Facility	*Mt. Hope Quarry Wharton, New Jersey (3/4" ASTM #57 Stone)*		*Totals*	
Today	0 Load	0 CY	0 Load	0 CY
Total	3 Load	60 CY	3 Load	60 CY

HALEY ALDRICH

DAILY FIELD REPORT

Samples Collected:

- None.

CAMP Activities:

- Air monitoring was performed at one upwind and one downwind location during ground intrusive activities. Two 15-minute average concentration of volatiles organic compounds (VOCs) or 15-minute average concentration of particulate matter smaller than 10 microns in diameter (PM10) exceeded the action levels.
    - Exceedance of PM10 were observed at the downwind station from 9:45 to 10:15 and 10:45 to 11:30 due to excavator exhaust in close vicinity to the downwind air monitoring station. When exceedances were observed, work was stopped and downwind air monitoring station was recalibrated to below exceedance levels prior to resuming work. No dust or exhaust was observed leaving the site.
    - PM10 and VOC data were not recorded at the upwind monitoring station at 7:30am to 8:45am, 9:00am to 9:15am, 2:15pm to 2:30pm, and 3:45pm to 4:00pm due to repeated battery outages. No odors or dust were observed during these times. The battery was replaced and recharged after each outage, and data collection at the upwind station resumed at 8:45am, 9:15am, 2:30pm, and 4:00pm, respectively.
    - PM10 and VOC data were not recorded at the downwind monitoring station at 7:30am to 8:45am, 9:00am to 9:15am, 11:45am to 12:15pm, and 1:15pm to 2:00pm due to repeated battery outages. No odors or dust were observed during these times. The battery was replaced and recharged after each outage, and data collection at the upwind station resumed at 8:45am, 9:15am, 12:15pm, and 2:00pm, respectively.


Activities Planned for Coming Week:

- Contractor will continue work on building foundation.
- Trucking soil for disposal.


Site Photographs:



Photo 1: Contractor receiving construction material deliveries, facing east.

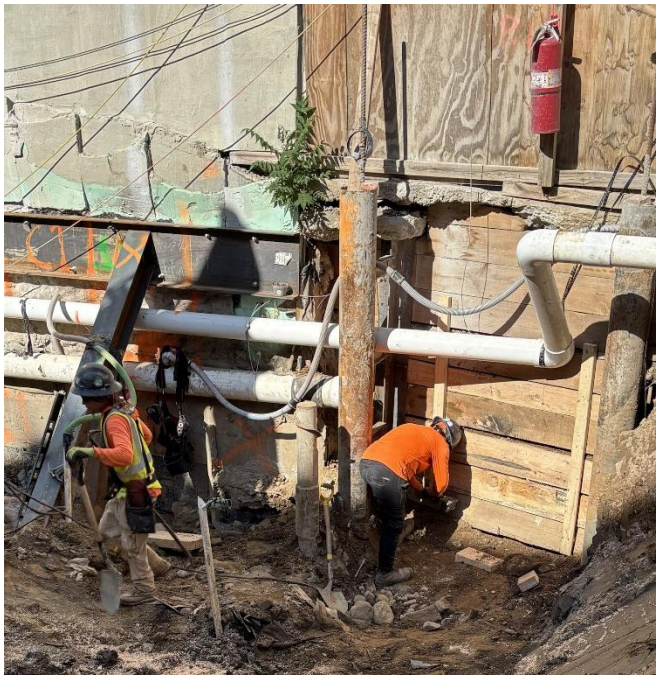

Site Plan:

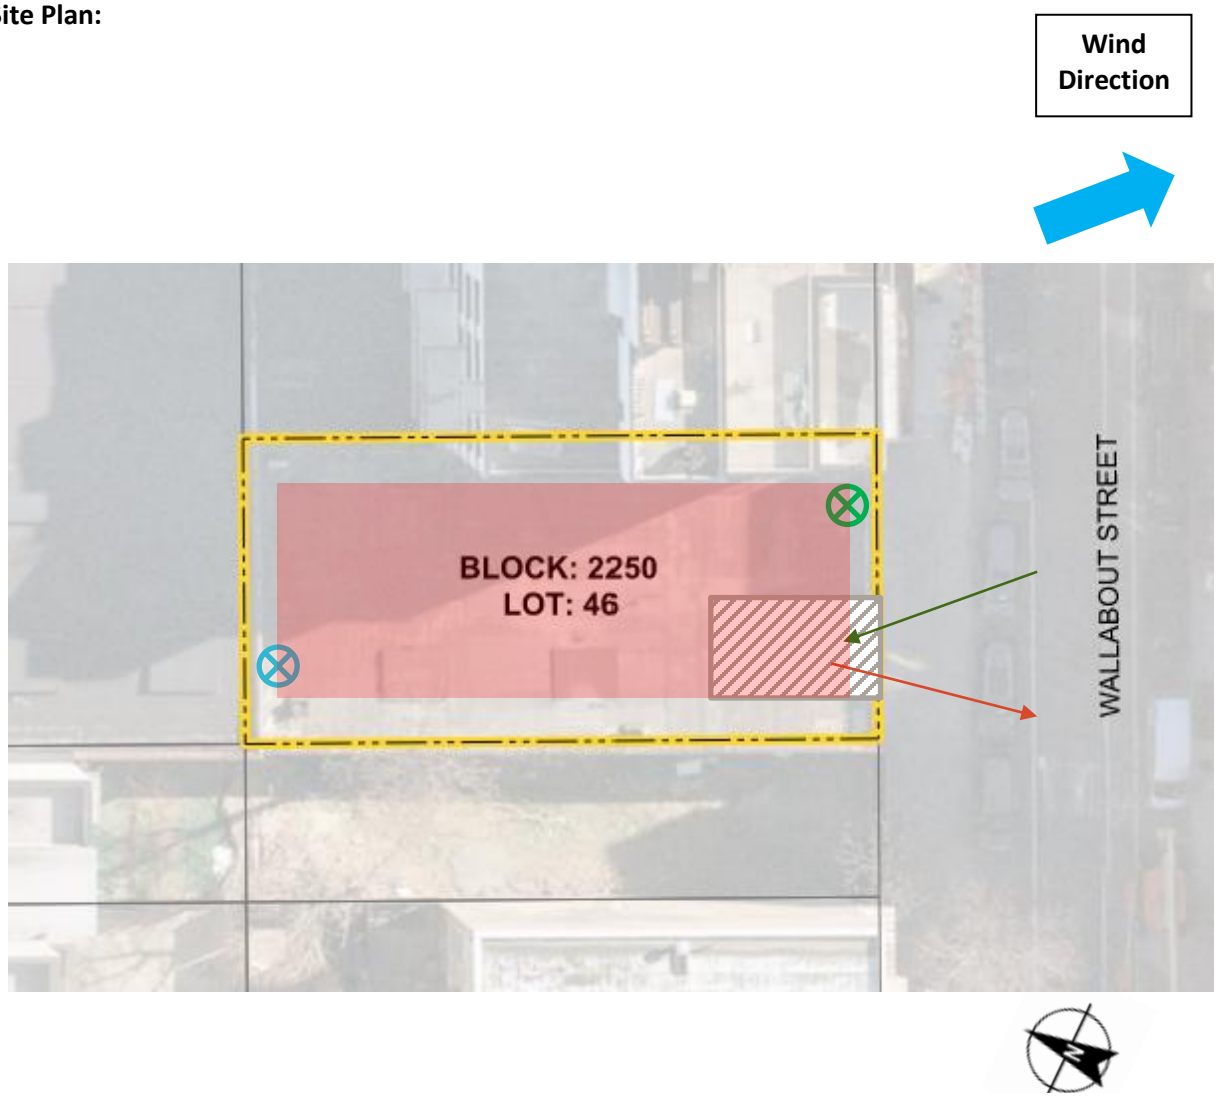

LEGEND:

- Upwind CAMP Station
- Downwind CAMP Station
- Stabilized Truck Entrance and Truck Wash Area
- Ingress
- Egress
- Approximate Work Area

291 Wallabout St Brooklyn

Air Monitoring Log

Date : 2026-08-26

Personnel : _____
Weather : _____
Humidity : _____
Wind Direction : _____

Particulate Background (ug/m3) : _____
PID Background (ppm) : _____

Action Levels : Downwind perimeter of work area above background levels
PID (ppm) : > 5 ppm for the 15-min average
Dust (ug/m3) : > 150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. VOC(Station1)	Avg. VOC(Station2)	Odors	Notes Activities/Additional Monitoring
06:30	4.220	3.520	0.0	0.0		
06:45	3.797	1.241	0.0	0.0		
07:00	6.060	1.923	0.0	0.0		
07:15	6.618	2.627	0.1	0.0		
07:30		2.249		0.0		
07:45		2.501		0.0		
08:00		2.483		0.0		
08:15		2.617		0.0		
08:30		3.163		0.0		
08:45	5.831	6.059	0.0	0.0		
09:00		4.817		0.0		
09:15	6.216	3.573	0.1	0.0		
09:30	16.233	3.826	0.1	0.0		
09:45	147.883	3.580	0.3	0.0		
10:00	10.854	3.494	0.0	0.0		
10:15	8.456	3.641	0.0	0.0		
10:30	9.349	3.496	0.0	0.0		
10:45	297.373	4.343	0.3	0.0		

291 Wallabout St Brooklyn

Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. VOC(Station1)	Avg. VOC(Station2)	Odors	Notes Activities/Additional Monitoring
11:00	310.491	7.161	0.4	0.0		
11:15	14.043	3.211	0.0	0.0		
11:30	7.298	3.385	0.0	0.1		
11:45	10.441		0.0			
12:00	9.637		0.0			
12:15	9.545	3.893	0.0	0.1		
12:30	8.274	3.285	0.0	0.1		
12:45	7.490	2.777	0.0	0.0		
13:00	5.137	3.496	0.0	0.0		
13:15	5.788		0.0			
13:30	7.066		0.0			
13:45	10.555		0.0			
14:00	9.593	4.205	0.0	0.0		
14:15		4.189		0.0		
14:30	24.730	5.051	0.0	0.0		
14:45	7.853	4.314	0.0	0.0		
15:00	8.187	4.529	0.0	0.0		
15:15	5.125	3.393	0.0	0.0		
15:30	5.206	3.300	0.0	0.0		
15:45		4.781		0.1		
16:00	5.424	4.251	0.0	0.1		
16:15	5.387	4.264	0.0	0.1		
16:30	4.769	3.836	0.0	0.1		
16:45	7.927	4.751	0.0	0.0		
17:00	10.180	5.166	0.0	0.0		
17:15	8.447	3.762	0.0	0.0		
17:30	4.417	3.589	0.0	0.0		
17:45	34.013	4.321	0.0	0.0		
18:00	18.816	4.530	0.0	0.1		
18:15	13.049	3.397	0.0	0.0		
18:30	13.348	3.080	0.1	0.0		

tblAllData (postgres)

Site Name	Station Na..	Serial Number	DateStart	DateEnd
H&A-291 Wallabout St Brooklyn	Station1	DS 01062022-2056	8/26/2026 ..	8/26/2026 6:34:00 ..
	Station2	DS 01062022-2057	8/26/2026 ..	8/26/2026 6:33:00 ..