#### PROJECT NUMBER 444-010-95

#### SEMI-ANNUAL GROUND WATER SAMPLING JAMECO INDUSTRIES, INC. 248 WYANDANCH, AVE WYANDANCH, NEW YORK

December 4, 1997

Prepared For:

New York State Department of Environmental Conservation

and

Camille Gagnon Watts Industries, Inc. P.O. Box 6431 South Main Street Franklin, NH 03235



Goldman Environmental Consultants, Inc. 60 Brooks Drive Braintree, MA 02184 (781) 356-9140

#### SEMI-ANNUAL GROUND WATER SAMPLING REPORT 248 WYANDANCH AVENUE WYANDANCH, NEW YORK

#### TABLE OF CONTENTS

<b>SECTION</b>	TITLE PAGE
1.0	Introduction1
2.0	Ground Water Sampling and Surveying2
3.0	Laboratory Analysis2
4.0	Conclusions
5.0	Warranty

#### **TABLES**

TABLE 1	GROUND WATER ELEVATION MEASUREMENTS
TABLE 2	SUMMARY OF LABORATORY RESULTS - VOCs
TABLE 3	SUMMARY OF LABORATORY RESULTS - Total Metals

#### **FIGURES**

FIGURE 1	SITE LOCUS MAP
FIGURE 2	SITE PLAN WITH SAMPLING LOCATIONS

#### APPENDICES

APPENDIX A	STANDARD OPERATING PROCEDURES
APPENDIX B	LABORATORY ANALYTICAL REPORTS

#### 1.0 Introduction

Goldman Environmental Consultants, Inc. (GEC) of Braintree, Massachusetts has been contracted by Watts Industries, Inc. (Watts) and Jameco Industries, Inc. (Jameco) to conduct Quarterly Ground Water Sampling at the Jameco facility located at 248 Wyandanch, Avenue in Wyandanch, New York. These activities are being conducted in accordance with Jameco's Maintenance Plan, that was approved by the New York Department of Environmental Conservation (NYSDEC).

The first quarterly sampling was conducted in July, 1994 by GEC and Jameco's previous consultants, AKRF, Inc. In conjunction with this sampling effort, GEC and AKRF also conducted a limited investigation to determine if there was evidence that a release of metals and/or chlorinated compounds had occurred beneath the site building. This investigation included the installation of three ground water observation wells through the floor of the building. As a result of this investigation dissolved-phase chlorinated compounds were detected in the shallow portions of the overburden aquifer beneath the building. Complete documentation of this investigation is presented in a document entitled <u>Maintenance Plan First Quarterly Report</u> prepared by AKRF and completed in August, 1994.

As a result of the investigations conducted by GEC and AKRF, and after conversations between GEC, Watts, and NYSDEC personnel, the scope of quarterly ground water sampling was amended so as to better characterize ground water conditions across the site. Changes in the scope were limited to adding one of the newly installed monitoring wells (MW-12) to the sampling list and removing two of the wells (MW-4 and MW-6) from the list. This revised sampling plan has been employed for several quarters. In addition, the sampling plan was further revised to reduce the frequency of sampling to semi-annual.

All activities were conducted in accordance with GEC's Standard Operating Procedures and QA/QC Plan, copies of which are attached as Appendix A.

#### Ground Water Sampling and Surveying

2.0

On October 29, 1997, GEC personnel collected ground water samples from monitoring wells MW-1, MW-2, MW-3, MW-5, MW-7, MW-9 and MW-12. Prior to sample collection the approximate volume of standing water in each well was computed and a volume of water equal to between three and five times the volume of standing water was evacuated from the monitoring well. GEC utilized dedicated or precleaned standard check-valve bailers or pre-cleaned electric submersible pumps. The samples were collected using dedicated plastic bailers or electric peristaltic pumps and were stored on ice in laboratory-issued, preserved, glass and nalgene containers. All samples were shipped overnight to AEN, (formerly IEA, Inc.), a New York State certified laboratory in Monroe Connecticut under fully documented chain of custody procedures.

Prior to initiation of well evacuation and sampling activities, GEC measured the depth to water in all of the on-site monitoring wells. GEC personnel conducted a survey of monitoring wells, using standard "rod and level techniques" to determine the relative elevation of the monitoring wells as part of previous site investigations. Depth to water and ground water elevation for these wells is included in this Sampling Report.

The results of the ground water gauging and well survey were used to determine the relative elevation of ground water at the site and to determine the direction of ground water flow. As a result of these activities, the ground water flow at the site appears to be toward the southeast. Complete results of the gauging and survey are included as Table 1.

#### 3.0 Laboratory Analysis

Ground water samples were submitted for laboratory analysis to determine the concentration of volatile organic compounds (VOCs) (via EPA Method 8260A), hexavalent chromium (via Colorimetric, 307-B Methods) and 13 Priority Pollutant Metals (total). The laboratory results are summarized on Tables 2 and 3 attached, and a complete laboratory report is included as Appendix B. Also included on these tables are the results of the sampling that was conducted during previous rounds. The results of these analyses are also summarized in the paragraphs below.

#### Volatile Organic Compounds

Results of recent analyses indicate that the concentrations of volatile organic compounds in ground water at the site remain essentially unchanged from previous sampling rounds. Contaminant concentrations in MW-2 have decreased, presumably as a result of source removal activities, while concentrations at MW-12 remain relatively unchanged. Benzene, previously detected at MW-12, was not detected during this sampling round. It is unclear if benzene reported for this well was the result of laboratory error or possibly sample contamination.

#### Hexavalent Chrome and Metals

Concentrations of total metals and hexavalent chrome remain essentially unchanged from previous sampling rounds. Concentrations are relatively low across the entire site but are somewhat higher in the immediate vicinity of the plating area (within the building footprint) and downgradient of the former leaching lagoons. Hexavalent chrome was not detected in any of the one observation wells.

#### 4.0 Conclusions

In accordance with the NYSDEC-approved Maintenance Plan, and on behalf of Jameco and Watts, GEC has completed the most recent round of ground water sampling at the Jameco facility, located at 248 Wyandanch, Avenue in Wyandanch, New York.

The results of the ground water sampling indicate that concentrations of volatile organic compound and metals remain generally unchanged from the previous sampling rounds. GEC will continue to collect ground water samples from designated wells on a regular basis. The next sampling round is tentatively scheduled for May, 1998 presuming the Remedial Investigation has not been initiated in the mean time.


#### 5.0 Warranty

The conclusions contained in this report are based on the information readily available to GEC as of December 3, 1996. GEC provides no warranties on information provided by third parties and contained herein. Data compiled was in accordance with GEC's approved scope of services, and the NYSDEC -approved Maintenance Plan and should not be construed beyond its limitations. Any interpretations or use of this report other than those expressed herein are not warranted. The use, partial use, or duplication of this report without the express written consent of Goldman Environmental Consultants, Inc. is strictly prohibited.

Respectfully submitted, Goldman Environmental Consultants, Inc.

Prepared By:

Samu<del>el</del> W. Butcher Vice President, Operations



## Table 1 GROUNDWATER ELEVATION MEASUREMENTS Jameco Industries, Inc. Wyandanch, Ave., Wyandanch, New York (unit, feet)

Well Number	Screened Interval Depth	Depth to Water	Measuring Point Elevation	Groundwater Elevation
MW-1				
10/4/94	6.43 to 16.43	11.27	101.47	90.20
1/26/95		11.08	101.47	90.39
4/19/95		11.15	101.47	90.32
7/24/95		12.34	101.47	89.13
10/12/95		12.72	101.47	88.75
1/17/96		11.88	101.47	89.59
4/11/96		10.21	101.47	91.26
10/9/96		10.93	101.47	90.54
4/16/97		9.80	101.47	91.67
10/23/97		11.67	101.47	89.80
MW-2				
10/4/94	6.00 to 16.00	11.02	100	88.98
1/26/95		10.79	100	89.21
4/19/95		10.90	100	89.10
7/24/95		11.92	100	88.08
10/12/95		12.16	100	87.84
1/17/96		Buried in snow	NA	NA
4/11/96		Covered	NA	NA
10/9/96		10.72	NA	NA
4/16/97		7.55	100	92.45
10/23/97		11.29	100	88.71
				00.71
<u>MW-3</u>				
10/4/94	9.91 to 19.91	14.61	102.57	87.96
1/26/95		14.44	102.57	88.13
4/19/95	2	14.56	102.57	88.01
7/24/95		15.49	102.57	87.08
10/12/95		15.83	102.57	86.74
1/17/96		15.05	102.57	87.52
4/11/96	55	13.53	102.57	89.04
10/9/96		14.39	102.57	88.18
4/16/97	4	12.50	102.57	90.07
10/23/97		15.23	102.57	87.34
<u>MW-4</u>				
10/4/94	10.05 to 20.05	13.85	103.41	89.56
1/26/95		13.60	103.41	89.81
4/19/95		13.73	103.41	89.68
7/24/95		14.63	103.41	88.78
10/12/95		15.07	103.41	88.34
1/17/96		14.11	103.41	89.30
4/11/96		12.61	103.41	90.80
10/9/96		13.55	103.41	89.86
4/16/97		11.60	103.41	91.81
10/23/97		14.31	103.41	89.10
<u>MW-5</u>				
10/4/94	6.27 to 16.27	10.44	99.32	88.88
1/26/95		10.18	99.32	89.14
4/19/95		10.37	99.32	88.95
7/24/95		11.31	99.32	88.01
10/12/95		11.64	99.32	87.68
1/17/96		Buried in snow	NA	NA
4/11/96		9.42	99.32	89.90
10/9/96		10.12	99.32	89.20
4/15/97		8.20	99.32	91.12
10/23/97		10.70	99.32	88.62

## Table 1GROUNDWATER ELEVATION MEASUREMENTSJameco Industries, Inc.Wyandanch, Ave., Wyandanch, New York<br/>(unit, feet)

Well Number	Screened Interval Depth	Depth to Water	Measuring Point Elevation	Groundwater Elevation
MW-6				
10/4/94	6.00 to 16.00	9.86	Not Found	NA
1/26/95		Not Found	NA	NA
4/19/95		Not Found	NA	NA
7/24/95		Not Found	NA	NA
10/12/95		Not Found	NA	NA
1/17/96		Not Found	NA	NA
4/11/96		Not Found	NA	NA
10/9/96		10	Not Found	NA
4/16/97		Not Found	Not Found	NA
10/23/97		Not Found	Not Found	NA
MW-7				
10/4/94	12.56 to 22.56	9.01	98.76	89.75
1/26/95		8.83	98.76	89.93
4/19/95		8.97	98.76	89.79
7/24/95		9.90	98.76	88.86
10/12/95		10.35	98.76	88.41
1/17/96		8.58	98.76 98.76 i	88.41 90.18
4/11/96		7.97	98.76	90.18
10/9/96		8.70	98.76	90.06
4/16/97		6.60	98.76	
10/23/97		9.36	98.76	92.16 89.40
20/ 20/ 2/		7.00	50.70	07.40
<u>MW-8</u>				
10/4/94	10.89 to 20.89	10.70	99.47	88.77
1/26/95		10.43	99.47	89.04
4/19/95		10.60	99.47	88.87
7/24/95		11.42	99.47	88.05
10/12/95		11.89	99.47	87.58
1/17/96	10 A	Buried in snow	NA	NA
4/11/96		9.64	99.47	89.83
10/9/96		10.34	99.47	89.13
4/16/97		8.30	99.47	91.17
10/23/97		10.79	99.47	88.68
<u>MW-9</u>				
10/4/94	10.57 to 20.57	8.90	97.80	88.90
1/26/95		8.68	97.80	89.12
4/19/95	3	8.88	97.80	88.92
7/24/95		9.72	97.80	88.08
10/12/95		9.98	97.80	87.82
1/17/96		9.28	97.80	88.52
4/11/96		7.88	97.80	89.92
10/9/96		8.55	97.80	89.25
4/16/97		6.85	97.80	90.95
10/23/97		9.25	97.80	88.55
<u>MW-10</u>		8.55	97.80	89.25
10/4/94	86.7 to 96.7	11.14	99.97	88.83
1/26/95		10.53	99.97	89.44
4/19/95		10.72	99.97	89.25
7/24/95		11.66	99.97	88.31
10/12/95		12.06	99.97	87.91
1/17/96		11.24	99.97	88.73
4/11/96		9.76	99.97	90.21
10/9/96		10.57	99.97	89.40
4/15/97		8.32	99.97	91.65
10/23/97		11.09	99.97	88.88

# Table 1 GROUNDWATER ELEVATION MEASUREMENTS Jameco Industries, Inc. Jameco Industries, Inc. Wyandanch, Ave., Wyandanch, New York (unit, feet)

Well Number	Screened Interval Depth	Depth to Water	Measuring Point Elevation	Groundwater Elevation
<u>MW-11</u>		~~		
10/4/94	50.0 to 60.0	10.77	99.95	89.18
1/26/95		10.54	99.95	89.41
4/19/95		10.66	99.95	89.29
7/24/95		11.61	99.95	88.34
10/12/95		12.10	99.95	87.85
1/17/96		11.21	99.95	88.74
4/11/96		9.68	99.95	90.27
10.09/96		10.45	99.95	89.50
4/16/97		8.24	99.95	91.71
10/23/97		11.00	99.95	88.95
<u>MW-12</u>				
10/4/94	5.35 to 15.35	11.79	99.97	88.18
1/26/95		10.51	99.97	89.46
4/19/95		10.66	99.97	89.31
7/24/95		11.66	99.97	88.31
10/12/95		12.08	99.97	87.89
1/17/96		11.20	99.97	88.77
4/11/96		10.10	99.97	89.87
10/9/96		10.47	99.97	89.50
4/16/97		8.24	99.97	91.73
10/23/97		11.05	99.97	88.92
MW-13*				
10/4/94		10.00/10.25	99.67	89.63**
1/26/95		9.85/9.86	99.67	89.82**
4/19/95		10.02/10.01	99.67	89.65**
7/24/95		Destroyed		
4/11/96		Destroyed		
10/9/96				Ð
4/16/97	4. A	Destroyed		
10/23/97		Destroyed		
MW-14				
7/24/95	3-20	Not Gauged	100.07	NA
10/12/95		11.98	100.07	88.09
1/17/96		Not Located	NA	NA
4/11/96		9.51	100.07	
10/9/96		10.26	100.07	89.81
4/16/97		7.55	100.07	92.52
10/23/97		Not Located	NA	NA
MW-15				
7/24/95	3-20	11.23/12.81	99.98	88.54**
10/12/95		Covered	NA	NA
1/17/96		10.93/11.38	99.98	88.99
4/11/96		9.50	99.98	90.48
10/9/96		10.20	99.98	89.78
4/16/97		8.24	99.98	91.74***
10/23/97		Not Gauged****	99.98	NA
10/29/97		11.08	99.98	88.90***
<u>MW-16</u>				
7/24/95	5-25	11.49	99.97	88.48
10/12/95		Not Gauged	NA	NA
1/17/96		Under equipment	NA	NA
4/11/96		9.62	99.97	90.35
10/9/96		DNF	1	
10/9/96 4/15/97		8.15	99.97	91.82

## Table 1GROUNDWATER ELEVATION MEASUREMENTSJameco Industries, Inc.Jameco Industries, Inc.Wyandanch, Ave., Wyandanch, New York<br/>(unit, feet)

Well Number	Screened Interval Depth	Depth to Water	Measuring Point Elevation	Groundwate Elevation
<u>MW-17</u>				
7/24/95	5-25	Not Accessible	100.03	NA
10/12/95		12.08	100.03	87.95
1/17/96		Under equipment	NA	NA
4/11/96		9.74	100.03	90.29
10/9/96		DNF		
4/16/97		8.46	100.03	91.57
10/23/97		11.16	100.03	88.87
1011 10				
<u>MW-18</u>	5.05			
7/24/95	5-25	11.55	99.97	88.42
10/12/95		12.02	99.97	87.95
1/17/96		11.16	99.97	88.81
4/11/96		9.65	99.97	90.32
10/9/96		10.42	99.97	89.55
4/16/97		8.24	99.97	91.73
10/23/97		10.98	99.97	88.99
MW-19				
7/24/95	5-25	11.21/13.35	100.00	88.51**
10/12/95	140000	Not Gauged	NA	NA
1/17/96		11.00/11.35	100.00	88.95
4/11/96		9.54	100.00	90.46
10/9/96		10.27	100.00	89.73
4/16/97	8.18	8.25	100.00	91.75
10/23/97	0110	11.35	101.00	89.65***
		11.00	101.00	07.05
<u>MW-20</u>				
7/24/95	5-25	11.47	100.00	88.53
10/12/95		Covered	NA	NA
1/17/96		11.09	100.00	88.91
4/11/96		9.63	100.00	90.37
10/9/96		10.33	100.00	89.67
4/16/97	-	8.38	100.00	91.62
10/23/97	1	11.03	100.00	88.97
MW-21				
7/24/95	3-20	11.46	100.00	00.40
10/12/95	3-20		100.02	88.48
1/17/96		11.96	100.02	88.06
Construction and the second		11.09	100.02	88.93
4/11/96		9.62	100.02	90.40
10/9/96		10.33	100.02	89.69
4/16/97		8.31	100.02	91.71
10/23/97		10.99	100.02	89.03
<u>MW-22</u>				
7/24/95	3-20	11.48	99.95	88.48
10/12/95		11.98	99.95	87.97
1/17/96		Covered	, NA	NA
4/11/96		9.58	99.95	90.37
10/9/96		10.30	99.95	89.65
4/16/97		8.16	99.95	91.79
10/23/97		10.90	99.95	89.05
MM				
MW-23	2.22		100.00	
7/24/95	3-20	11.45	100.10	88.48
10/12/95		11.92	100.10	88.18
1/17/96		11.07	100.10	89.03
4/11/96		9.57	100.10	90.53
10/9/96		10.31	100.10	89.79
4/16/97		8.10	100.10	92.00
10/23/97		10.71	100.10	89.39
MW-24				
10/9/96	6-21	9.99	NA	NA

#### Table 1 GROUNDWATER ELEVATION MEASUREMENTS

Jameco Industries, Inc. Wyandanch, Ave., Wyandanch, New York (unit, feet)

Well Number	Screened Interval Depth	Depth to Water	Measuring Point Elevation	Groundwater Elevation
<u>MW-25</u>				
10/9/96	6-21	9.90	NA	NA
10/23/97		Not Found	NA	NA
MW-26				
10/8/96	6-20	9.98	NA	NA
10/23/97		Under Roll-off	NA	NA

= Previously referred to as "Mystery Well"
 \*\* = Corrected for Petroleum Thickness assuming density of 0.87

Product thickness not measured during the 10/12/95 gauging event.

\*\*\*= Trace of product noted

= Evidence of product noted. Gauged on 10/29/97 with oil/water interface probe. Approximately 0.53 feet of product observed during 10/29/97 gauging event.

### Table 2 Groundwater Analytical Results: Volatile Organic Compounds (VOCs) Jameco Industries, Inc. 248 Wyandanch Avenue Wyandanch, New York (cost, perty peblics (pd))

Identification MW-1 5/23/94 1/27/95 4/19/95 1/12/95 10/12/95 1/17/96 4/11/96 10/10/96 4/11/97 10/29/97 MW-2 6/91 5/23/94 1/27/95 1/12/95 10/12/95 10/12/95	Benzene ND ND ND ND ND ND ND ND ND ND ND ND ND	methane ND ND ND ND ND ND ND ND ND ND	form ND ND ND ND ND ND	ethane ND ND ND ND ND	ethene ND ND ND	Benzene ND NA	Chloride ND	pentanone 7.0	butyl ether	chloroethane	ethene	Toluene	ND	ethane 11	ethane	ethene	benzene	Chloride	(total)
5/23/94 1/27/95 4/19/95 7/24/95 10/12/95 10/12/95 10/12/95 10/12/95 4/15/97 10/29/97 MW-2 6/91 5/23/94 1/27/95 4/19/95 7/24/95 10/12/95	ND N		ND ND ND ND ND ND	ND ND ND ND	ND ND			7.0				ATT:	ND					1.000	
1/27/95 4/19/95 7/24/95 10/12/95 10/12/95 1/17/96 4/11/96 10/10/96 4/15/97 10/29/97 MW-2 6/91 5/23/94 1/27/95 4/19/95 7/24/95	ND N		ND ND ND ND ND	ND ND ND	+ ND	NA				ND	ND				ND	ND	ND		ND
4/19/95 7/24/95 10/12/95 1/17/96 4/11/96 4/15/97 10/29/97 MW-2 6/91 5/23/94 1/27/95 4/19/95 7/24/95 10/12/95	ND ND ND ND ND ND ND ND ND		ND ND ND ND	ND ND		NA	0.2 ND	NA	NA	ND	ND	ND	ND	30	ND	ND	ND	ND	NA
7/24/95 10/12/95 1/17/96 4/11/96 10/10/96 4/15/97 10/29/97 MW-2 6/91 5/23/94 1/27/95 4/19/95 7/24/95 10/12/95	ND ND ND ND ND ND ND ND	ND ND ND ND ND	ND ND ND	ND	ND	NA ND	ND 1.0	NA NA	NA	ND 0.3	ND ND	ND ND	ND ND	0.6	ND	ND	ND	ND	NA
10/12/95 1/17/96 4/11/96 10/10/96 4/15/97 10/29/97 MW-2 6/91 5/23/94 1/27/95 7/24/95 10/12/95	ND ND ND ND ND ND ND ND	ND ND ND ND ND	ND ND		ND	ND	ND	ND	NA	ND	ND	ND	ND	0.6	ND ND	ND ND	ND ND	ND ND	ND ND
4/11/96 10/10/96 4/15/97 10/29/97 MW-2 6/91 5/23/94 1/27/95 4/19/95 7/24/95 10/12/95	ND ND ND ND	ND ND	ND	ND	ND	ND	ND	ND	NA	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
10/10/96 4/15/97 10/29/97 MW-2 6/91 5/23/94 1/27/95 4/19/95 7/24/95 10/12/95	ND ND ND ND	ND		ND	ND	ND	7.1	NA	3.0	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
4/15/97 10/29/97 MW-2 6/91 5/23/94 1/27/95 4/19/95 7/24/95 10/12/95	ND ND ND	ND	ND	ND	ND	ND	ND	ND	1.7	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
10/29/97 MW-2 6/91 5/23/94 1/27/95 4/19/95 7/24/95 10/12/95	ND		ND	ND	ND	ND	ND	ND	NA	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
MW-2 6/91 5/23/94 1/27/95 4/19/95 7/24/95 10/12/95	ND		ND	ND	ND*	ND	ND	ND	NA	ND	ND	ND	ND*	ND	ND	ND	NA	ND	ND
6/91 5/23/94 1/27/95 4/19/95 7/24/95 10/12/95		ND	ND	ND	ND*	ND	ND	ND	NA	ND	2JB	ND	ND*	ND	ND	ND	NA	ND	ND
5/23/94 1/27/95 4/19/95 7/24/95 10/12/95		ND	ND					014011	2012/01/	in the second		-	C. Provense						
1/27/95 4/19/95 7/24/95 10/12/95		ND	ND	ND ND	ND ND	ND NA	ND 0.3	ND	NA	ND	1,500	ND	ND	12	ND	5,400	ND	ND	ND
4/19/95 7/24/95 10/12/95	ND	ND	ND	ND	ND	NA	ND ND	NA NA	NA NA	ND ND	28 26	ND ND	ND ND	4.0 ND	0.4	1,200	0.2	12	NA
7/24/95 10/12/95	ND	ND	ND	ND	ND	ND	ND	NA	NA	ND	11	ND	ND	ND	ND ND	180 46	ND ND	33 6.0	NA ND
	ND	ND	ND	ND	ND	ND	ND	ND	NA	ND	0.5	ND	ND	ND	ND	5.0	ND	ND	ND
	ND	ND	ND	ND	ND	ND	6.7	ND	NA	ND	ND	ND	ND	ND	ND	21	ND	ND	ND
10/10/96	ND	ND	ND	ND	48	ND	ND	ND	NA	ND	37	ND	ND	ND	ND	7.0	ND	1.01	ND
4/15/97	ND	ND	ND	ND	470*	ND	ND	ND	NA	ND	93	ND	470*	ND	ND	1,400	NA	13]	ND
10/29/97	ND	ND	ND	ND	25*	ND	ND	ND	NA	ND	.8j	ND	2]*	ND	ND	5	NA	ND	ND
MW-3																			
6/91	ND	ND	ND	ND	ND	ND	ND	ND	NA	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
5/23/94	ND	ND	ND	ND	ND	NA	0.2	NA	NA	ND	ND	ND	ND	ND	ND	10	ND	ND	NA
1/27/95 4/19/95	ND ND	ND	ND	ND	ND	NA	ND	NA	NA	ND	ND	ND	ND	ND	ND	4.0	ND	ND	NA
4/19/95	ND	ND	ND ND	ND ND	ND	ND ND	ND ND	NA	NA	ND	25	ND	ND	ND	ND	170	ND	ND	ND
10/12/95	ND	ND	ND	ND	ND	ND	ND 12	ND	NA NA	ND ND	4.0 ND	ND ND	ND ND	ND ND	ND	12	ND	ND	ND
1/17/96	ND	1.8***	ND	ND	ND	ND	8.1	NA	NA	ND	17	ND	ND		ND	ND	ND	ND	ND
4/11/96	ND	ND	ND	ND	29	ND	1.1	ND	ND	ND	3.9	ND	ND	ND ND	ND	5.3 94	ND ND	ND ND	ND ND
10/10/06	ND	ND	ND	ND	25	ND	ND	ND	NA	ND	9.0	ND	ND	ND	ND	160	ND	ND	ND
4/15/97	ND	ND	ND	ND	1.0]*	ND	ND	ND	NA	ND	1.0	ND	1.01	ND	ND	38	NA	ND	ND
10/29/97	ND	ND	ND	ND	6*	ND	ND	ND	NA	ND	1)	ND	6*	ND	ND	14	NA	ND	ND
MW-5											it						144	146	140
6/91	ND	ND	ND	ND	ND	2.0	6.0	46	NA	ND	30	14	ND	30	ND	17	ND	ND	5.0
5/23/94	ND	ND	ND	ND	ND	NA	0.3	NA	NA	ND	9.0	0.9	ND	0.2	ND	14	ND	5.0	NA
1/27/95	ND	ND	ND	ND	ND	NA	ND	NA	NA	ND	5.0	ND	ND	ND	ND	5.0	ND	0.5	NA
4/19/95	ND	ND	ND	ND	ND	ND	ND	NA	NA	ND	4.0	ND	ND	ND	ND	5.0	ND	ND	ND
7/24/95 10/12/95	ND	ND ND	ND	ND	ND	ND	ND	ND	NA	ND	280	ND	ND	ND	ND	9.0	ND	ND	ND
4/11/96	ND	ND	ND ND	ND	ND	ND	11	ND	NA	ND	11	ND	ND	ND	ND	5.6	ND	ND	ND
10/10/96	ND	ND	ND	ND ND	81 13	ND	ND ND	ND 3.0[B	4.1	ND	ND	ND	ND	ND	ND	2.0	ND	7.5	ND
4/15/97	ND	ND	ND	ND	90*	ND	ND	ND	NA NA	ND ND	5.0 32	ND ND	ND 90*	ND ND	ND	40	ND	30	ND
10/29/97	ND	ND	21	ND	21*	ND	ND	ND	NA	ND	32 40	ND	21*	ND	ND	11 180	NA NA	3.0J ND	ND ND
MW-7				110				190	1975	ND	10	ND	- 21	NO	ND	150	NA	NU	ND
6/91	ND	ND	ND	ND	ND	ND	ND	ND	NA	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
5/23/94	ND	ND	ND	ND	ND	NA	0.3	NA	NA	ND	30	ND	ND	ND	ND	4.0	ND	ND	NA
1/27/95	ND	ND	ND	ND	ND	NA	ND	NA	NA	ND	39	ND	ND	ND	ND	3.0	ND	ND	NA
4/19/95	ND	ND	ND	ND	ND	ND	ND	NA	NA	ND	15	ND	ND	ND	ND	0.6	ND	ND	ND
7/24/95	ND	ND	ND	ND	ND	ND	ND	ND	NA	ND	13	ND	ND	ND	ND	0.8	ND	ND	ND
1/17/96	ND	ND	ND	ND	ND	ND	12	ND	NA	ND	51	ND	ND	ND	ND	9.7	ND	ND	ND
4/11/96	ND	ND	ND ND	ND ND	2.9	ND	7.6	NA	1.3	ND	17	ND	ND	ND	ND	1.3	ND	ND	ND
10/10/96	ND	ND	ND	ND	ND	ND	2.3 ND	ND	1.2	ND	13	ND ND	ND	ND	ND	ND	ND	ND	ND
4/15/97	ND	ND	ND	ND	21*	ND	ND	ND	NA	ND ND	2.0J 51	ND	ND 21*	ND	ND	160	ND	ND	ND ND
10/29/97	ND	ND	ND	ND	38*	ND	ND	ND	NA	ND	44	ND	38*	ND	ND	9	NA	ND	ND
MW-9							110					140		IND.	NU	,	INA	ND	ND
6/91	ND	ND	ND	ND	ND	ND	ND	ND	NA	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
5/23/94	ND	ND	ND	ND	ND	NA	ND	NA	NA	ND	2	ND	ND	ND	ND	0.3	ND	ND	NA
1/27/95	ND	ND	ND	ND	ND	NA	ND	NA	NA	ND	ND	ND	ND	ND	ND	ND	ND	ND	NA
4/19/95	ND	ND	ND	ND	ND	ND	ND	NA	NA	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
7/24/95	ND	ND	ND	ND	ND	ND	ND	ND	NA	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
10/12/95	ND	ND	ND	ND	ND	ND	11	ND	NA	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
1/17/96	ND	ND	58	ND	ND	ND	8.8	NA	3.9	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
4/11/96	ND	ND	ND	ND	ND	ND	ND	ND	3.0	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
4/15/97	ND	ND ND	ND ND	ND	ND 2.01*	ND	ND	ND	NA	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
10/29/97	ND	ND	ND	ND	2.0J*	ND	ND	ND	NA	ND	ND	ND	2.0]*	ND	ND	ND	NA	ND	ND
MW-12	110	ND .	INLY	NU	NU	NU	NU	ND	NA	ND	ND	ND	ND*	ND	ND	ND	NA	ND	ND
6/91	ND	ND	ND	ND	ND	NA	NA	NA	NA	NA	NA	NA	ND	NA	NA	NA	NIT	Ne	N+
5/23/94	ND	ND	ND	ND	ND	NA	NA	NA	NA	NA	NA	NA	ND	NA	NA	NA	NA NA	NA NA	NA
1/27/95	ND	ND	ND	ND	ND	NA	370	NA	NA	ND	120	ND	ND	ND	ND	3,300	ND	ND	NA
4/19/95	ND	ND	ND	ND	ND	ND	ND	NA	NA	ND	400	ND	ND	ND	ND	1,500	ND	58	ND
7/24/95	ND	ND	ND	ND	ND	ND	ND	ND	NA	ND	100	ND	ND	ND	ND	1,800	ND	54	ND
10/12/95	ND	ND	ND	ND	ND	ND	11	ND	NA	ND	75	ND	ND	6.7	ND	1,700	ND	17	ND
1/17/96	ND	ND	13	ND	ND	ND	8.0	NA	ND	ND	75	ND	18	5.3	ND	1,400	ND	ND	ND
4/11/96	ND	ND	5.0	8.9	1,400	ND	14	1.2	ND	ND	220	ND	23	15	1.5	4,200	ND	94	ND
10/10/96	ND	ND	ND	ND	1,800	ND	30)	ND	NA	ND	190	ND	ND	ND	ND	1,900	ND	66]	ND
4/15/97 10/29/97	680 ND	ND	ND 761	ND	580*	ND	25J ND	ND	NA NA	ND ND	360 120	120 ND	580* 400*	ND	ND	3,400	NA	ND ND	ND ND

-

100

-

-

Noises Standard\* refers to the groundwater standard for each element for Class GA groundwaters (6NYCRR Parts 700-705) MDL- Mathed Detection Limit NA - Not Analyzed ND - Not Detected NS - Not Sampled MDL- Ranged from 200 pb to 12 pb depending on analysis and element. No compounds were detected above detection limits for samples from 6/91 and 5/18/94. Wells that were not sampled on specific dates were moliculade in the sample identification column. Laboratory analyses were conducted via EFA Method 3580 or 542 or equivalent. Complete laboratory for the full 7/27 /95 sampling are included in CEN Quarterly Meeting Report. Information on this table issummarized from previous investigations. A Reported as that 2. doublest research and 2-becarance were detected in several samples. These results were not tabulated as they are considered laboratory contaminants and not representative of site conditions. \*\*\* No guidance value raine 12\_-doublest research as were detected in several samples. These results were not tabulated as they are considered laboratory contaminants and not representative of site conditions. \*\*\* You guidance value raine 12\_-doublest research as any less of the sample. The concentration listed is an estimated value. B - Analyte is found in the blanks as well as the sample.

Table 3	
Groundwater Analytical Results: Total Metals	


Jameco Industries, Inc.


248 Wyandanch Avenue Wyandanch, New York

Sample						Hexavalent								1
dentification MW-1	Antimony	Arsenic	Beryllium	Cadmium	Chromium	Chromium	Copper	Lead	Mercury	Nickel	Selenium	Silver	Thallium	Zi
5/23/95	32.0	0.019	ND	ND	0.029	0.020	0.026	0.035	ND	ND	ND	ND	ND	0.1
1/27/95	ND	0.042	ND	0.007	0.065	ND	0.084	0.056	0.000	0.042	ND	0.010	ND	0.1
4/19/95	ND	0.035	ND	0.006	0.040	NA	0.054	0.044	ND	ND	ND	ND	ND	0.1
7/24/95	ND	0.048	ND	0.008	0.052	ND	0.071	0.044	0.000	ND	ND	ND	ND	0.1
10/27/95	NA	0.083	NA	ND	0.075	ND	NA	0.057	ND	NA	ND	ND	NA	N
1/17/96	ND	0.129	0.006	ND	0.124	ND	0.141	0.086	ND	0.105	0.006	ND	ND	0.3
4/11/96	ND	0.051	ND	ND	0.053	ND	0.063	0.042	ND	0.043	ND	ND	ND	0.1
10/10/96	0.006	0.025	0.003	0.003	0.037	ND	0.044	0.034	0.000	0.026	0.004	0.001	0.006	0.1
4/15/97	ND	0.039	0.002B	ND	0.043	ND	0.052E	0.034	ND	0.035B	ND	ND	ND	0.
10/29/97	ND	0.0052B	ND	ND	0.0046B	ND	0.0064B	ND	ND	0.0051B	ND	ND	ND	0.0
MW-2												110		0.0
5/23/95	0.038	0.007	ND	ND	8.88	0.240	3.16	0.087	ND	4.49	ND	ND	ND	0.3
1/27/95	ND	0.030	ND	0.014	4.00	ND	3.80	0.079	0.000	5.70	ND	0.010	ND	0.1
4/19/95	ND	0.060	ND	0.021	4.90	NA	3.50	0.110	0.000	4.30	ND	ND	ND	0.0
7/24/95	ND	0.054	ND	0.019	3.90	ND	4.10	0.100	0.001	3.60	ND	ND	ND	0.0
10/27/95	NA	0.086	NA	ND	4.09	ND	NA	0.108	0.004	NA	ND	0.014	NA	N
10/10/96	0.006	0.068	0.004	0.016	3.01	ND	3.34	0.082	0.000	2.53	0.014	0.001	0.011	0.
4/15/97	0.004B	0.007B	ND	0.002B	0.482	ND	0.830E	0.020	NR	10.2	ND	ND	ND	0.3
10/29/97	ND	0.053	0.0037B	ND	0.059	ND	0.0837	0.0582	ND	0.0538	0.0059	ND	ND	0.3
MW-3														
5/23/95	ND	ND	ND	ND	0.119	0.020	0.597	ND	ND	1.75	ND	ND	ND	0.1
1/27/95	ND	ND	ND	ND	0.320	ND	4.50	ND	ND	3.50	ND	0.011	ND	0.0
4/19/95	ND	ND	ND	ND	0.200	NA	2.80	ND	ND	2.00	ND	ND	ND	0.3
7/24/95	ND	ND	ND	ND	0.061	ND	6.60	ND	0.000	4.20	ND	ND	ND	0.8
10/27/95	NA	ND	NA	ND	0.201	ND	NA	0.041	ND	NA	ND	ND	NA	N
1/17/96	ND	ND	ND	ND	0.226	ND	4.63	0.027	ND	2.64	ND	ND	ND	0.4
4/11/96	ND	0.010	ND	ND	0.490	ND	3.03	0.043	ND	3.35	ND	ND	ND	0.4
10/10/96	0.006	0.006	0.001	0.001	0.183	ND	1.60	0.033	0.000	1.67	0.004	0.001	0.010	0.3
4/15/97	0.006B	0.006B	ND	0.001B	0.188	ND	0.436E	0.019	ND	0.402	ND	ND	ND	0.1
10/29/97	ND	0.0298	0.0021B	ND	1.440	ND	2.170	0.0484	ND	3.530	ND	ND	ND	0.3
MW-5		2022201	27922-17		and the second second	100,000,000								
5/23/95	0.040	0.029	ND	ND	0.117	0.020	0.639	0.022	ND	0.373	ND	ND	ND	0.5
1/27/95	ND	0.046	ND	0.007	0.100	ND	0.730	0.020	ND	0.230	ND	0.013	ND	0.4
4/19/95	ND	0.049	ND	0.008	0.130	NA	0.920	0.038	ND	0.270	ND	ND	ND	0.4
7/24/95	ND	0.048	ND	0.007	0.100	ND	0.750	0.018	0.000	0.190	ND	ND	ND	0.3
10/27/95	NA	0.087	NA	ND	0.221	ND	NA	0.038	ND	NA	ND	ND	NA	N
4/11/96	ND	0.099	ND	ND	0.222	ND	1.33	0.041	0.000	0.469	0.005	ND	ND	0.8
10/10/96	0.006	0.075	0.003	0.009	0.220	ND	1.160	0.038	0.000	0.475	0.012	0.001	0.015	0.5
4/15/97	0.003B	0.033	ND	ND	0.052	ND	0.308E	0.012	ND	0.191	0.003BN	ND	ND	0.3
10/29/97	ND	ND	ND	ND	0.0467	ND	0.142	0.0056	ND	0.265	ND	ND	ND	0.1
MW-7 5/23/95	NID	0.005	NID	NID.									The second se	
1/27/95	ND	0.005	ND	ND	ND	0.010	ND	0.006	ND	0.025	ND	ND	ND	0.0
4/19/95	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	0.011	ND	N
7/24/95	ND	ND	ND	ND	ND	NA	ND	ND	ND	ND	ND	ND	ND	N
10/27/95	ND	ND	ND	0.005	ND	ND	0.013	ND	ND	ND	ND	ND	ND	0.0
1/17/96	NA ND	0.015	NA	ND	0.021	ND	NA	0.011	ND	NA	ND	ND	NA	N
4/11/96	ND	0.010	ND	ND	ND	ND	0.020	0.007	ND	ND	0.007	ND	ND	0.0
10/10/96	0.006	ND	ND	ND	ND	ND	0.020	0.009	ND	ND	ND	ND	ND	0.0
4/15/97	0.004B	0.006	0.001	0.001	0.012	ND	0.013	0.005	0.000	0.007	0.004	0.001	0.010	0.0
10/29/97	ND	0.013	ND 0.0013B	ND	0.011	ND	0.066E	0.012	ND	0.009B	ND	ND	ND	0.0
MW-9	IND	0.0724	0.00136	ND	0.124	ND	0.670	0.0222	ND	0.250	ND	ND	ND	0.4
5/23/95	ND	ND	NID	NID	NID	0.010		0.005				and the second sec	10/22/2	
1/27/95	ND	ND	ND ND	ND ND	ND ND	0.010 ND	ND	0.005	ND	ND	ND	ND	ND	0.0
4/19/95	ND	ND	ND	ND	ND	NA	ND ND	ND ND	ND	ND	ND	0.011	ND	0.0
7/24/95	ND	0.013	ND	ND	0.017	ND	0.019	0.010	ND ND	ND ND	ND	ND	ND	0.0
10/27/95	NA	0.013	NA	ND	0.017	ND	0.019 NA	0.010	ND	NA	ND ND	ND	ND	0.1
1/17/96	ND	0.013	ND	ND	0.021	ND	0.028	0.013	ND	0.016	ND	ND	NA	N
4/11/96	ND	0.012	ND	ND	ND	ND	0.028	0.014	ND	0.016	ND	ND ND	ND ND	0.1
10/10/96	0.006	0.006	0.001	0.001	0.008	ND	0.022	0.004	0.002	0.018	0.004	0.001	0.015	0.1
4/15/97	ND	ND	ND	0.004B	0.003BE	ND	ND	ND	ND	ND	0.004 ND	ND	0.015 ND	10
10/29/97	ND	0.0112	ND	ND	0.0142	ND	0.0149B	0.0062	ND	0.0113B	ND	ND	ND	0.1
MW-12										0.01100	no	ND	ND	0.1
5/23/95	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	N
1/27/95	0.180	0.110	0.019	0.082	18.0	ND	21.0	0.310	0.001	21.0	0.006	ND	ND	5.
4/19/95	ND	0.100	0.015	0.059	14.0	NA	25.0	0.230	0.001	22.0	ND	ND	ND	4.
7/24/95	0.160	0.073	0.011	0.050	10.0	ND	13.0	0.160	0.001	16.0	ND	ND	ND	3.
10/27/95	NA	0.047	NA	0.017	5.87	ND	NA	0.090	0.005	NA	ND	ND	NA	N
1/17/96	ND	0.042	ND	ND	ND	ND	ND	0.076	0.000	9.74	ND	ND	ND	4.
4/11/96	ND	0.025	ND	ND	2.55	0.022	6.73	0.046	0.000	38.8	ND	ND	ND	5.
10/10/96	0.006	0.015	0.003	0.008	2.07	ND	7.26	0.036	0.000	37.2	0.004	0.001	0.012	2.
4/15/97	0.003B	0.006B	ND	0.002B	0.739	ND	4.06E	0.011	ND	18.6	ND	ND	ND	1.3
10/29/97	ND	0.0054B	ND	ND	0.621	ND	2.160	0.0102	ND	8.340	ND	ND	ND	0.7
Standard	0.003**	0.025	0.003	0.010	0.050	0.050	0.200	0.025	0.002	No Stnd.	0.010	0.050	0.004**	0.3
Refers to a Guida ium was detecte MDL= ND= NA=	the groundwat ince value wher d during 10/12	er standard fo e no Standard /95 sampling	or each elemen 1 exists. 1 period betwee	en 43.5 and 870	ppm.	NYCRR Parts 70 n to 0.2 ppm dep		ysis and ele	ment.					
NR= B=	Not Required Indicates anal				quired detectio									



.

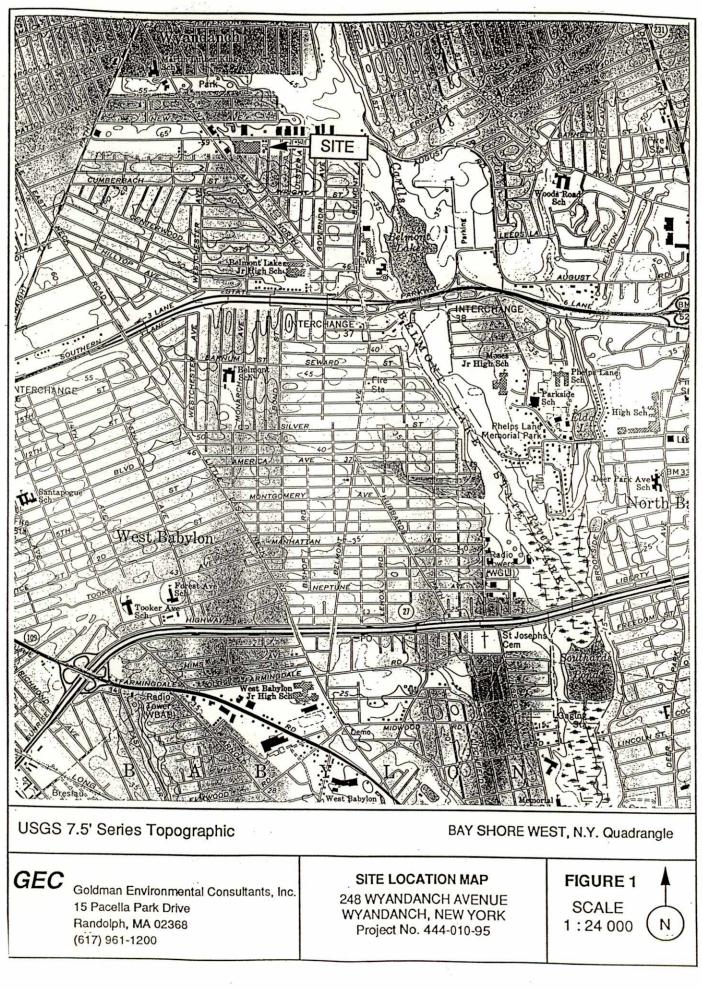

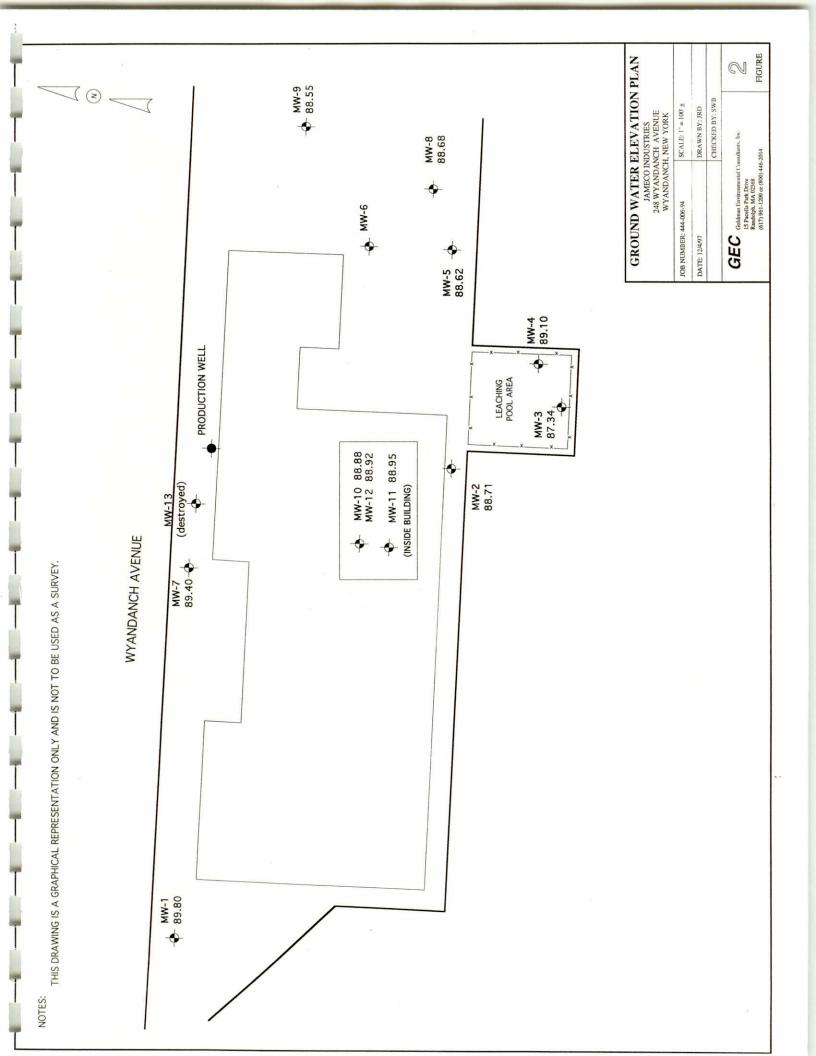

#### APPENDIX A

#### STANDARD OPERATING PROCEDURES

### **Goldman Environmental Consultants**

Standard Operating Procedures

#### Standard Operating Procedure Observation Well Sampling Using a Bucket-Type Bailer

This protocol is designed to ensure that proper techniques are used, safety is considered and quality assurance maintained during the performance of observation well sampling. A GEC representative is assigned to oversee and/or perform all observation well sampling for the project. The duties of the representative are to ensure that the scope of work is followed.

Sampling of groundwater observation wells is the primary means by which the chemical characteristics of groundwater can be determined. Therefore, it is imperative that care be taken in the development and subsequent sampling of observation wells. Water standing in the well prior to sampling may be stagnant and may not be representative of true groundwater quality in the aquifer in question

Procedures for performance of groundwater observation well evacuation and sampling are outlined in the following paragraphs:

#### Well Evacuation:

- 1) Prior to initiating any work the Health and Safety Plan, developed for the specific site activities, should be reviewed by all field personnel. The indicated measures on the Plan should be enacted prior to initiation of the sampling activities. Any concerns not addressed in the Plan are to be brought immediately to the attention of the Health and Safety Officer. Personnel participating in the sampling will dress with protective equipment appropriate for the anticipated conditions.
- 2) Decontaminate all equipment to be used in the performance of the activities in accordance with the protocol for decontamination. Decontamination should at least be performed by alternately rinsing all equipment with methanol and distilled water and vigorously scrubbing the equipment with a clean brush.
- 3) To the extent that contamination may be known at a given site, observation wells should be sampled in an order from "least contaminated" to "most contaminated".
- 4) Screen the well headspace with a photoionization detector (PID) or other appropriate instrumentation to confirm that concentrations of potential contaminants are within acceptable limits.
- 5) Test the well for accumulation of non-aqueous phase product (NAPL) using a pre-cleaned interface probe or transparent disposable bailer. If present, collect a sample of the NAPL and place in an appropriate sample container. This sample should be kept away from other samples.
- 6) Measure and record the depth to NAPL(if present), depth to water, and total depth of the wells. If NAPL is present, sampling for dissolved-phase contaminants should generally not be performed. In addition, if sampling is to be performed, appropriate measures should be taken to assure that any water removed from a contaminated well is disposed appropriately.
- 7) Calculate the volume of saturated well casing and the volume of water which will be removed to assure sufficient well evacuation. Evacuate well water into a clean, small (< 0.5 gallons), bucket or similar vessel in which precleaned and calibrated conductivity and pH probes have been placed. Attach a precleaned bailer to cable or line for lowering the bailer into the well. Lower the bailer slowly into the well until it contacts the water surface. Allow the bailer to sink and fill with a minimum of surface disturbance. Raise the bailer to the surface. Do not allow the bailer line to</p>

contact the ground. Drain the bailer into the bucket.

- 8) Purging should continue until between three and five well volumes have been evacuated and pH, temperature, and specific conductivity values do not vary appreciably or until evacuated water is of construct and minimal turbidity.
- 9) Record final pH, conductivity and temperature values if appropriate.

#### Well Sampling:

- Sampling of observation wells will be conducted only with clean, decontaminated Teflon, or stainless steel sampling bailers or with clean disposable bailers. Disposable bailers shall not be re-used for any purpose. In addition, disposable gloves are worn for each individual well sampling, and line used to support the bailer is to be discarded between wells.
- 2) Samples at any given well will be collected in order of decreasing order of sensitivity to volatilization (i.e. VOC, total organic carbon, semi-volatile organics (BNA), ammonia, PCBs, pesticides, oil and grease, phenols, cyanide, sulfate and chloride, nitrate and ammonia, metals and radionuclides).
- 3) Lower the bailer slowly until it contacts the water surface. Allow the bailer to sink to a point such that the bailer becomes filled with water, but not to the point where the string comes in contact with the water. <u>Note</u>: Under specific sampling conditions this sample collection procedure may vary. Under these conditions specific notation is required regarding any modifications or amendments made to the Protocol.
- 4) Slowly raise the bailer to the surface and remove the bailer from the well. Care should be taken to ensure that the string and bailer do not come in contact with the ground or other potential contaminant sources.
- 5) Carefully and slowly transfer the contents of the bailer into appropriately preserved, pre-labeled containers. Check that the sample containers seal properly and that the cap is sealed tightly. Record applicable information in the field logbook and complete all chain-of-custody documents.
- 6) Discard string, and discard or decontaminate the bailer appropriately.

#### Standard Operating Procedure Field Sampling Protocols Quality Assurance/Quality Control

The purpose of the GEC QA/QC program is to generate analytical data that is of known and defensible quality. These procedures apply to all projects in which sampling is involved. QA/QC from one project is not transferable to another.

#### Decontamination

- Decontamination should be performed on all reusable field sampling equipment and protective gear. Sampling equipment should be decontaminated before the collection of a sample and after sampling has been completed. Protective gear should be decontaminated after the collection of a sample.
- 2) It is necessary to use the following decontamination solutions in the field:
  - Non-phosphate detergent plus tap water wash.
  - Distilled / deionized water rinse.
  - 10% Nitric Acid rinse.\*
  - Methanol rinse, when sampling volatiles only.
  - Acetone then hexane rinse.\*\*
  - Distilled / deionized water rinse. \*\*
  - \* Only if sample is to be analyzed for metals.
  - \*\* Only if sample is to be analyzed for semi-volatile organics, PCBs or pesticides.
- Sample bottles and sampling equipment should not be stored near gasoline, solvents, or other potential sources of contamination. If unavoidable bottles and equipment should be sealed in containers or plastic.
- 4) Heavy equipment, including hand tools, should be cleaned by steam cleaning or manual scrubbing prior and subsequent to use in hazardous waste investigations.

#### Measures or Quality Control/Quality Assurance

- 1) Trip Blanks
  - Trip blanks are used in order to detect additional sources of contamination that might affect analytical results. The following are potential sources of additional contamination:
    - a. Sample containers,
    - b. Contamination during shipment to and from the site,
    - c. Ambient air contact with analytical instrumentation at the laboratory during analysis, or
    - d. Laboratory reagent used in analytical procedures.
  - One trip blank is required for every set of samples sent to the lab regardless of job size. Generally, the trip blank should be for VOCs. If, however, VOCs are not a parameter of the sampling round, consult the laboratory as to which parameter should have an associated trip blank.

- Trip blanks are to be kept with containers used in the sampling round at all times. More specifically, they should accompany the site specific sampling containers from the time the containers leave the laboratory until they are returned for analysis.
- Obtain containers and trip blanks prepared specifically for each job from the laboratory. Return unused containers to the laboratory upon completion of a project.

#### 2) Field Blanks

- Field blanks are used to indicate potential contamination contracted from ambient air or from sampling equipment. It also serves as a QA/QC for decontamination procedures.
- Collect one set of field blanks for every 20 samples per project. It is not necessary to take a field blank for jobs in which less than 10 samples are collected.
- Procedure
  - a. Collect two sets of sample containers to cover all sampling parameters. One set will be full of analyte free water (obtain extra analyte free water to fill two VOA vials). The other set is empty.
  - b. Go to the most contaminated area and run the water from the full containers, through the decontaminated sampling equipment and into the associated empty containers.
  - c. Send to the lab for analysis.
- Use containers and field blanks prepared specifically for job.
- 3) Duplicate Samples
  - Duplicate samples are collected in order to serve as a laboratory check. Therefore, it is important that the lab does not know which samples are to serve for this purpose.
  - Frequency
    - a. Obtain one (1) duplicate sample for every 10 samples of each matrix. If less than ten samples are collected of a given matrix, a duplicate must be collected anyway.
    - b. If a total of less than 10 samples are collected, collect one (1) duplicate of the majority medium.
    - c. If a total of less than five (5) samples are collected, it is not necessary to collect a duplicate sample.
  - \* Note that the frequency as outlined here pertains to the number of samples collected per project, not per location of a given project.
  - Procedures

The idea behind the duplicate sample is to collect two samples as close to identical as possible.

a. For water

Alternately fill containers for the same parameter with equal amounts of liquid per bailer. Fill duplicate VOC vials from the same bailer of liquid.

b. For soil

- VOC samples must be taken from the discreet sampling locations.
- For all other samples, mix the applicable soil in a decontaminated stainless steel or polyethylene bowl or tray. Then fill sample containers with the soil mix.
- When confronted with the option of collecting a water sample or a soil sample, choose the water sample.
- Labeling for the laboratory
  - a. Label the containers normally and give the duplicate samples different reference numbers.
  - b. Indicate the quantity of duplicates in the "special instructions" or "remarks" portion of the chain of custody and laboratory services sheet, however, do not indicate the reference numbers of the duplicates.
  - c. Upon receipt of analytical results, contact the laboratory and convey all data pertaining to the duplicates for their QA/QC.
- 4) Background samples
  - Background samples are taken only if it is required for comparison of site conditions to the surrounding environment. This is to be dictated by client needs on a site to site basis.
- 5) Performance Evaluation Samples
  - The project manger should consider the use of the following performance evaluation samples on a periodic basis. Typically, these will be reserved for larger jobs:
    - a. Laboratory performance evaluation samples
    - Collect duplicate samples and send to two different laboratories for comparison. Avoid using soil samples for this procedure.
    - Send a sample of known quantity and quality to the laboratory in order to determine laboratory performance. Such samples can be prepared by any laboratory.
    - b. Gas chromatograph (GC) performance evaluation samples
    - Acquire a sample of known quantity and quality from a laboratory. Analyze the sample with the gas chromatograph in order to determine the integrity of GC results.

#### Field Sampling QA/QC

- 1) When sampling a well, collect VOA samples first and Oil & Grease samples last.
- Start sampling at the presumed least contaminated areas, proceeding to the more contaminated areas.
- 3) Preservatives
  - Consult the laboratory in order to determine which sampling parameters require preservatives. The laboratory will provide sampling containers specific for each job.
  - It is necessary to fill the sample container when using preserved bottles; preservative is added with this assumption
  - If samples are not collected correctly, they will not pass GEC QA/QC.

- 4) A chain-of-custody must accompany each set of samples from the job site to the laboratory. Be sure to identify the presence of trip blanks on the chain-of-custody sheets.
- 5) If possible, use the numbering system outlined on the attached sheet for identifying samples.

#### **Ordering Sample Containers**

- 1) Pre-plan sampling strategy to determine the sample parameters, the number of sample points including QA/QC samples, and the matrix of the given sample points.
- 2) Call laboratory and tell them:
  - Sample parameters,
  - Number of samples to be collected,
  - · The number of container sets needed for trip blanks, field blanks, and duplicates, and
  - The matrix of each sample to be collected.
- 3) Sample containers should be ordered specifically for each job. Any sample containers unused at the end of the job should be sent back to the laboratory.

#### Conclusions

- 1) Pre-planning is crucial.
- 2) Keep open communication with the laboratory on all matters.
- 3) If you make a mistake in sampling collection, accept it, and retake the necessary samples.

#### Standard Operating Procedure Decontamination Procedures for Field Equipment

All field equipment (bailers, well sounder, gloves, etc.) must be decontaminated before each use, between samples and before it is returned to the equipment room. Decontamination procedures vary for the type of analyses to be performed. The following basic procedures should always be used to decontaminate equipment regardless of the type of analysis:

- 1) Scrub equipment with soapy water (Liquinox, Alconox, trisodiumphosphate or equivalent).
- 2) Rinse with tap water, if available.
- 3) Rinse with deionized water from green spray bottle.

For Metals, perform the following additional procedures:

- 4) Rinse with 10% nitric acid (HNO<sub>3</sub>).
- 5) Final rinse with deionized water.

For base/neutral/acid extractables, PCB's and pesticides perform the following, additional procedures:

- 4) Rinse with acetone and let dry.
- 5) Rinse with hexane and let dry.
- 6) Final rinse with deionized water.

For Volatile Organics and all other analyses, perform the following additional procedures:

- 4) Rinse with methanol.
- 5) Final rinse with deionized water

<u>NOTE</u>: When sampling for more than one of the above types of analyses, use the protocol for volatile organics last.

Solvent use should be gauged carefully so that a minimal amount of solvent is left after use. Allow any remaining solvent to evaporate. 2) Sample integrity is assured by use of containers appropriate to both the matrix to be sampled and the analytes of interest. Sample containers must be prepared in the laboratory in a manner consistent with USEPA protocols. Unless the proper sample bottle preparation and sample preservation measures are taken in the field, sample composition can be altered by contamination, degradation, biological transformation, chemical interaction, and other factors during the time between sample collection and analysis. Prior to sampling GEC personnel will ensure that the sample containers obtained from either a laboratory or a commercial supplier have been prepared in accordance with DEP and EPA protocols. Sample containers are to be used once and discarded. Under no circumstance should a soil, water or gaseous media which has been collected for analysis be placed in a previously used sample container unless that container has been recleaned and preserved by a certified laboratory.

As part of the COC protocol, sample containers should have prepared labels for each sample. The label should include sample identification, date and time of collection, sample parameters to be analyzed, any preservatives used, and the name of the sample collector.

Upon collection of the sample(s), documentation of chain of custody (i.e. COC form) should be initiated and should include at least the following:

- date and time of sampling;
- sampling locations;
- sample bottle identification;
- and specific sample acquisition measures.

The COC and sample description requires:

- a unique identification of each sample;
- the name(s), address(es) and telephone number(s) of the sampler(s) and the person(s) shipping the samples and all subsequent transfers of custody;
- the type and method of analyses requested;
- the date and time of sample collection and transfer of custody; and the name(s) of those responsible for receiving the samples at the laboratory.
- 3) In some cases, field filtration of samples may be required. Information regarding the method of filtration should be determined in advance and communicated to the laboratory. Filtering of any sample collected for organic analysis should be avoided. Decanting of a liquid media is a preferred method for the removal of particulate matter. When field filtering is required, an appropriate filter medium must be selected to avoid potential sample contamination during the filtering process.
- 4) Sample holding times are specified for the initiation of chemical analyses, usually beginning at the time of sample collection but occasionally beginning at the time of sample receipt at the laboratory. This determination must be made prior to sampling to allow proper logistical planning for sample shipments. Holding times also vary with the regulatory basis under sampling take place in order to properly schedule work.
- 5) Sample containers are most often packed in plastic, insulated "coolers" for shipment. Bottles are to be packed tightly so that only minimal motion of the sample containers is possible. Materials which are considered to be highly hazardous may require special handling and packing for shipment. Ice, or a similar heat transfer fluid, should be placed over the top of the sample containers and should be placed within a water tight plastic bag to assure that the samples are kept as dry as possible. In addition, all applicable paper work should also be enclosed within a second water-tight bag and included in the cooler.

The sample cooler should then be taped shut.

6) Upon receipt of the samples at the laboratory, any laboratory identification numbers should also be included on the COC form. Finally, those responsible for receipt of the samples should be indicated on the COC form as well as the date and time of the sample drop-off.

#### Standard Operating Procedure Sample Preservation and Chain of Custody

This protocol is designed to ensure that proper techniques are employed in the preservation and chain-of custody of samples collected for laboratory analyses or for screening. This Protocol is intended to be consistent with Massachusetts Publication #WSC-310-91 (Standard References for Monitoring Wells), and 40 CFR 136 (Guidelines Establishing Test Procedures for the Analysis of Pollutants).

The results of screening and/or laboratory analysis of solid, liquid or gaseous media constitute the basis of evaluation of the majority of the disposal sites under investigation. It is therefore imperative that the preservation of the samples be appropriate to the media being analyzed as well as the analysis which is being performed. In addition, the integrity of the sample is dependent upon the premise that a clear chain of responsibility for the sample integrity has been maintained. Without this "Chain-of-Custody", the integrity of the laboratory results may inevitably come into question.

The preservation and Chain-of-Custody (COC) protocols outlined in the following paragraphs are not intended to be all inclusive, and this protocol is written with the understanding that the sampling of certain media or analyses may require specific sample preservation. This protocol is, however, intended to cover the majority of the media and analyses performed as well as the COC procedures employed at the majority of waste disposal sites.

A COC program must be followed during sampling and handling activities from the field through laboratory operations. This program is designed to assure that each sample is accounted for at all times. Field data sheets, COC records, and sample labels must also be completed by the appropriate sampling and laboratory personnel for each sample. The objective of the sample custody identification and control system is to assure, to the extent practical, that:

- all samples are uniquely identified;
- the correct samples are analyzed for the correct parameters and are traceable through their records;
- important sample characteristics are preserved;
- samples are protected from damage or loss;
- any processing of samples (e.g., filtration, preservation) is documented; and
- client confidentially is maintained.

A sample is considered under a COC if it meets all of the following criteria:

- the sample is in your custody,
- the sample is in your view, after being in your possession,
- the sample is in your possession and then you locked it up to prevent tampering, and
- the sample is in a designated, secured area.

The following paragraphs outline GEC's preservation and COC protocol.

 Prior to initiating any work, the Health and Safety Plan developed for the specific site activities should be reviewed by all field personnel. The indicated measures on the Plan should be enacted prior to initiation of any sampling activities. Any concerns not addressed in the Plan are to be brought immediately to the attention of the Health and Safety Officer. Personnel participating in the excavations will dress with protective equipment appropriate for the anticipated conditions.

#### Standard Operating Procedure Completion of Field Notes

This protocol is designed to ensure that proper techniques are used during the collection and preparation of field notes. Field notes are collected in field notebooks, which are often the only source of "first hand" information regarding activities that were conducted at a site. Field notes may be called into a court of law; therefore, it is imperative that field notes be maintained in a thorough and proper manner.

All field notes should be completed in a water-proof notebook and should not be completed on loose sheets of paper that might get lost or misplaced. All field notes should be completed in permanent ink, rather than pencil and should be neat and orderly. Use of a pencil for collection of field notes is acceptable only in extremely poor weather conditions. All field notes taken during the field activities should be photocopied immediately after completion of the activities and placed in the project file to preserve a permanent record of the activities. In addition, when conducting field activities, the following information should also be collected:

- the date and time of the field activities (both the start and the finish time) including the time that certain "milestones" are achieved;
- weather conditions on the day of the field activities (in some cases it may also be appropriate to include the weather conditions for the previous day, such as when a heavy snow fall has occurred);
- the names and affiliations of all personnel involved in the field activities;
- the purpose of the field activities (e.g., groundwater sampling, site inspection, UST removal);

The field notes should accurately reflect a chronology of the activities that were conducted at the site. The following are examples of information that should be included in the field notes, but might not be applicable in all situations:

- the time that subcontractors, clients, police details, consultants or other persons arrived and left the site;
- a site sketch indicating the approximate location of groundwater observation wells to be sampled, borings to be installed, test pits to be performed, utilities to be located or suspected underground storage tanks, abutters (Note: site sketches should be included even when a site plan has been provided. If a site sketch is not feasible, the site plan that is being used to locate structures should be referenced);
- reference to any other documents that are completed during the course of the site activities that may include additional information not included in the field book, including: Chain of Custody forms; Test Boring Reports; Test Pit Reports; Manifests and calibration log books;
- a site sketch indicating areas where snow cover, vehicles, debris or other obstructions may have limited site inspection, sampling or otherwise prohibited the completion of activities;
- where and when field instruments (e.g., PID, OVA) are being used, all calibration and sampling/screening conditions should be logged;
- any unsafe conditions observed by GEC personnel and presented to on-site personnel or subcontractors;
- observations made during site inspections or field activities including, but not limited to: the locations of stained soils or stressed vegetation; noticeable odors; the presence of nonaqueous-phase liquid.

It is the responsibility of each GEC employee to maintain his/her own field book. All field books are the property of GEC and in the event that the employee terminates employment with GEC the field books are to remain at GEC.

#### APPENDIX B

#### LABORATORY ANALYTICAL REPORTS

### American Environmental Network



200 Monroe Turnpike • Monroe, CT 06468 • (203) 261-4458 • Fax (203) 268-5346

November 25, 1997

Mr. Sam Butcher GOLDMAN ENVIRONMENTAL 60 Brooks Drive Braintree, MA 02184

Dear Mr. Butcher :

Please find enclosed the analytical results of 13 sample(s) received at our laboratory on October 30, 1997. This report contains sections addressing the following information at a minimum:

analytical methodology . analytical results state certifications . chain-of-custody		· · · · · · · · · · · · · · · · · · ·
--	--	---------------------------------------

IEA Report #7097-2582A	Purchase Order #444-010-95
Project ID: JAMECO INDUSTRIES	

Copies of this analytical report and supporting data are maintained in our files for a minimum of five years unless special arrangements have been made. Unless specifically indicated, all analytical testing was performed at this laboratory location and no portion of the testing was subcontracted.

We appreciate your selection of our services and welcome any questions or suggestions you may have relative to this report. Please contact your customer service representative at (203) 261-4458 for any additional information. Thank you for utilizing our services; we hope you will consider us for your future analytical needs.

I have reviewed and approved the enclosed data for final release.

Very truly yours, . Curran y Manager

JCC

Analytical Services For The Environment

#### 7097-2582A GOLDMAN ENVIRONMENTAL

#### Case Narrative

**Classical Chemistry** - Listed below are the wet chemistry analyte methods and references for all samples analyzed in this SDG. No analytical problems were encountered and all holding times were met.

Analyte	Method	Reference
Hexavalent Chromium	7196	1

#### References:

1. Test Methods for the Evaluation of Solid Waste, SW846, 3rd edition, 1986.

Metals - ICAP metals were determined using a JA61E trace ICAP; mercury was determined by the cold vapor technique utilizing the Thermo Jarrell Ash Model QS-1 E mercury analyzer using guidance provided in SW846 according to the following Methods: ICAP-3010/6010; mercury-7470.

One asterisk "\*" resulted from duplicate analysis of sample MW-2 for zinc. There is no apparent reason for this flag.

No other problems occurred during analysis. All appropriate protocols were employed. All data appears to be consistent.

IEC's are electronically employed by the JA61E trace ICAP. However, the ICSA is utilized as a monitoring device to detect any additional adjustments that may be required. These modifications are calculated and applied manually. They are so noted in the raw data.

Volatile Organics - Volatile organics were determined by purge and trap GC/MS using guidance provided in Method 8260A. The instrumentation used was a Tekmar Dynamic Headspace Concentrator interfaced with a Hewlett-Packard Model 5995/5972A GC/MS/DS.

The "L" flag on the form 6A's designate that linear regression was used for quantitation for that compound, due to the %RSD being 15% or greater. The form 1A's reflect the true concentration calculated with linear regression. The quant reports may not agree with form 1A's, due to software limitations. All results for compounds with "L" flags should be taken from either tabulated results or form 1A's.

Sample Calculation:

Sample ID - MW-7 Compound - Tetrachloroethene

 $\frac{(1216763)(250)(1)}{(2871295)(.476)(5)} = 44.51 = 44 \text{ UG/L}.$ 

Sample MW-12 was analyzed at a 1:25 dilution due to high target compound concentrations.

No problems were encountered.

Aqueous

#### TABLE VO-1.0 7097-2582A GOLDMAN ENVIRONMENTAL TCL VOLATILE ORGANICS + TIC'S

All values are ug/L.

Client Sample I.D. Lab Sample I.D. Method Blank I.D. Quant. Factor Chloromethane Bromomethane Vinyl Chloride	Method Blank VBLKDW VBLKDW 1.00 U U U U U U	MW-2 972582A-01 VBLKDW 1.00 U U	MW-3 972582A-02 VBLKDW 1.00 U	Quant. Limits with no Dilution 10
Lab Sample I.D. Method Blank I.D. Quant. Factor Chloromethane Bromomethane	Blank VBLKDW VBLKDW 1.00 U U U U	972582A-01 VBLKDW 1.00 U U	972582A-02 VBLKDW 1.00 U	Limits with no Dilutior
Lab Sample I.D. Method Blank I.D. Quant. Factor Chloromethane Bromomethane	VBLKDW VBLKDW 1.00 U U U U	972582A-01 VBLKDW 1.00 U U	VBLKDW 1.00 U	Limits with no Dilutior
Method Blank I.D. Quant. Factor Chloromethane Bromomethane	VBLKDW 1.00 U U U U	VBLKDW 1.00 U U	VBLKDW 1.00 U	Limits with no Dilutior
Method Blank I.D. Quant. Factor Chloromethane Bromomethane	VBLKDW 1.00 U U U U	VBLKDW 1.00 U U	VBLKDW 1.00 U	with no Dilution
Quant. Factor Chloromethane Bromomethane	1.00 U U U U	1.00 U U	1.00 U	Dilution
Chloromethane Bromomethane	U U U	U U	υ	
Bromomethane	U U	Ŭ		10
Bromomethane	U			
Vinvl Chloride			ប	10
ATHAT CHTOLTGE	ТТ	U	U	10
Chloroethane		U	U	10
Methylene Chloride	U	U	U	5.0
Acetone	U	U	ប	10
Carbon Disulfide	U	U	U	5.0
Vinyl Acetate	U	U	ប	10
1,1-Dichloroethene	U	U	U	5.0
1,1-Dichloroethane	U	U	U	5.0
1,2-Dichloroethene (total)	Ū	2J	6	5.0
Chloroform	Ū	υ	U	5.0
1,2-Dichloroethane	Ū	υ	U	5.0
2-Butanone	Ū	Ū	Ū	10
1,1,1-Trichloroethane	Ū	Ū	Ū	5.0
Jarbon Tetrachloride	Ŭ	Ū	Ū	5.0
Bromodichloromethane	Ū	Ū	Ū	5.0
1,2-Dichloropropane	Ŭ	Ū	Ū	5.0
cis-1,3-Dichloropropene	Ŭ	υ	Ū	5.0
Trichloroethene	Ŭ	5	14	5.0
Dibromochloromethane	U U	υ	Ū	5.0
	U	U U	Ū	5.0
1,1,2-Trichloroethane	U U	υ	υ	5.0
Benzene	υ	υ	υ	5.0
trans-1,3-Dichloropropene		U U	U U	5.0
Bromoform	U	ט ד	U U U	10
4-Methyl-2-Pentanone	U	U U U	U U	10
2-Hexanone	<u>U</u> : .	.8J	1J	5.0
Tetrachloroethene	U			5.0
Toluene	U	U U	U U	5.0
1,1,2,2-Tetrachloroethane	Ü		U U	5.0
Chlorobenzene	U	U	ן ט ע	5.0
Ethylbenzene	U	U		· · · · · · · · · · · · · · · · · · ·
Styrene	Ŭ	U U	U U	5.0
Xylene (total)	U			<u> </u>
Date Received		10/30/97	10/30/97	
Date Extracted	N/A	N/A	N/A	
Date Analyzed	11/01/97	11/01/97	11/01/97	

See Appendix for qualifier definitions Note: Compound detection limit = quantitation limit x quantitation factor Quant. Factor = a numerical value which takes into account any variation in sample weight/volume, % moisture and sample dilution.

Aqueous

#### TABLE VO-1.1 7097-2582A GOLDMAN ENVIRONMENTAL TCL VOLATILE ORGANICS + TIC'S

All values are ug/L.

	MW-5	MW-7	
Client Sample I.D.	MM-2	Idw- /	 Quant.
Lab Sample I.D.	972582A-03	972582A-04	Limits
Method Blank I.D.	VBLKDW	VBLKDW	with no
Quant. Factor	1.00	1.00	 Dilution
	υ	U	10
Chloromethane	U U	υ	10
Bromomethane	U U	Ŭ	10
Vinyl Chloride Chloroethane	Ŭ	Ŭ	10
Methylene Chloride	U U	Ŭ	5.0
	Ŭ	Ŭ	10
Acetone Carbon Disulfide	Ū	υ	5.0
	υ	υ	10
Vinyl Acetate	U U	υ	5.0
1,1-Dichloroethene	υ	Ū	5.0
1,1-Dichloroethane (total)	21	38	5.0
1,2-Dichloroethene (total)	2J	υ	5.0
Chloroform	U	υ	5.0
1,2-Dichloroethane	υ	υ	10
2-Butanone	U U	υ	5.0
1,1,1-Trichloroethane	U	Ŭ	5.0
Jarbon Tetrachloride	U U	Ŭ	5.0
Bromodichloromethane	υ	Ŭ	5.0
1,2-Dichloropropane	U U	υ	5.0
cis-1,3-Dichloropropene	180	9	5.0
Trichloroethene	010000000000000000000000000000000000000	U U	5.0
Dibromochloromethane	U	U U	5.0
1,1,2-Trichloroethane	U	U U	 5.0
Benzene	Ŭ	υ	5.0
trans-1,3-Dichloropropene	U	U U	5.0
Bromoform	U	U U	10
4-Methyl-2-Pentanone	U	U U	10
2-Hexanone	U 40	44	5.0
Tetrachloroethene	40 U	U U	5.0
Toluene	<b>U</b>	υ	5.0
1,1,2,2-Tetrachloroethane	U U	U U	5.0
Chlorobenzene		U U	5.0
Ethylbenzene	U	U U	5.0
Styrene	บ บ	U	5.0
Xylene (total)	U		1
Date Received	10/30/97	10/30/97	
Date Extracted	N/A	N/A	
Date Analyzed	11/01/97	11/01/97	

See Appendix for qualifier definitions Note: Compound detection limit = quantitation limit x quantitation factor Quant. Factor = a numerical value which takes into account any variation in sample weight/volume, % moisture and sample dilution.

## TABLE VO-1.2 7097-2582A GOLDMAN ENVIRONMENTAL TCL VOLATILE ORGANICS + TIC'S

All values are ug/L.

	Method		MW-1	
Then the demain of D	Blank	MW-1	MS	
Client Sample I.D.	DIalik	MW-T	mo	Quant.
	VBLKDZ	972582A-07	972582A-07MS	Limits
Lab Sample I.D.	VBLKDZ	VBLKDZ	VBLKDZ	with no
Method Blank I.D.	1.00	1.00	1.00	Dilution
Quant. Factor	1.00	1.00	1.00	DIIdeio
Chloromethane	U	υ	υ	10
Bromomethane	U	ប	U U	10
Vinyl Chloride	U	U	υ	10
Chloroethane	U	U	U	10
Methylene Chloride	U	U	U	5.0
Acetone	U	U	U	10
Carbon Disulfide	U	υ	U	5.0
Vinyl Acetate	ប	ប	U U	10
1,1-Dichloroethene	U	U U	46X	5.0
1,1-Dichloroethane	Ū	Ū	U	5.0
1,2-Dichloroethene (total)	Ū	U	U	5.0
Chloroform	Ū	Ū	U U	5.0
1,2-Dichloroethane	Ū	U . U	U U	5.0
2-Butanone	Ŭ	Ū	Ū	10
1,1,1-Trichloroethane	Ŭ	U U	Ū	5.0
Carbon Tetrachloride	Ū	U U	Ū	5.0
Bromodichloromethane	Ŭ	Ū	T T	5.0
1,2-Dichloropropane	Ŭ	Ŭ	Ŭ	5.0
	U U	υ	Ū	5.0
cis-1,3-Dichloropropene	υ	U U	48X	5.0
Trichloroethene	U U U	U U	U	5.0
Dibromochloromethane	U U	U U	Ŭ	5.0
1,1,2-Trichloroethane	U U	U U	46X	5.0
Benzene	บ บ	U U	U	5.0
trans-1,3-Dichloropropene			U U	5.0
Bromoform	U	U U U	U	10
4-Methyl-2-Pentanone	U	U U	UUU	10
2-Hexanone	U	2JB	5B	5.0
Tetrachloroethene	4J		46X	5.0
Toluene	U	U U	46A U	5.0
1,1,2,2-Tetrachloroethane	U U		48X	5.0
Chlorobenzene	Ŭ	U U		5.0
Ethylbenzene	U		U	5.0
Styrene	U	U	U U	5.0
Xylene (total)	U	U		5.0
Date Received		10/30/97	10/30/97	
Date Extracted	N/A	N/A	N/A	
Date Analyzed	11/04/97	11/04/97	11/04/97	

See Appendix for qualifier definitions Note: Compound detection limit = quantitation limit x quantitation factor Quant. Factor = a numerical value which takes into account any variation in sample weight/volume, % moisture and sample dilution.

## TABLE VO-1.3 7097-2582A GOLDMAN ENVIRONMENTAL TCL VOLATILE ORGANICS + TIC'S

All values are ug/L.

	MW-1		
Client Sample I.D.	MSD	TB 102997	
citene bampie 1.b.	972582A-07		Ouant.
Lab Sample I.D.	MSD	972582A-08	Limits
Method Blank I.D.	VBLKDZ	VBLKDZ	with no
Quant. Factor	1.00	1.00	Dilutio
Chloromethane	U	υ	10
Bromomethane	U	U U	10
Vinyl Chloride	U	υ	10
Chloroethane	U	U U	10
Methylene Chloride	U U	U U	5.0
Acetone	U	υ	10
Carbon Disulfide	U	U	5.0
Vinyl Acetate	<b>U</b>	ן מ	10
1,1-Dichloroethene	48X	U U	5.0
1,1-Dichloroethane	U	U U	5.0
1,2-Dichloroethene (total)	Ū	υ	5.0
Chloroform	Ū	U U	5.0
1,2-Dichloroethane	Ū	U	5.0
2-Butanone	Ū	Ū	10
1,1,1-Trichloroethane	Ū	υ	5.0
Carbon Tetrachloride	Ū	Ū	5.0
Bromodichloromethane	Ū	U U I	5.0
1,2-Dichloropropane	Ū	Ū	5.0
cis-1,3-Dichloropropene	Ū	l Ū	5.0
Trichloroethene	47X	U U	5.0
Dibromochloromethane	U U	U U U	5.0
1,1,2-Trichloroethane	Ŭ	l ŭ l	5.0
Benzene	46X	Ū	5.0
trans-1,3-Dichloropropene	U	Ū	5.0
Bromoform	Ŭ	Ŭ	5.0
4-Methyl-2-Pentanone	Ŭ	Ŭ Ŭ	10
2-Hexanone	Ū	1 Ū	10
Tetrachloroethene	1JB	3JB	5.0
Toluene	47x	υ	5.0
1,1,2,2-Tetrachloroethane	Ű	U U	5.0
Chlorobenzene	49X	υ υ	5.0
Ethylbenzene	Ū	U U	5.0
Styrene	Ū	Ū	5.0
Xylene (total)	<u> </u>	Ū	5.0
Date Received	10/30/97	10/30/97	
Date Extracted	N/A	N/A	
Date Analyzed	11/04/97	11/04/97	

See Appendix for qualifier definitions Note: Compound detection limit = quantitation limit x quantitation factor Quant. Factor = a numerical value which takes into account any variation in sample weight/volume, % moisture and sample dilution.

## TABLE VO-1.4 7097-2582A GOLDMAN ENVIRONMENTAL TCL VOLATILE ORGANICS + TIC'S

All values are ug/L.

		2		
	Method		10	
Client Sample I.D.	Blank	MW-9	MW-12	Quant.
		0705003 05	972582A-06	Limits
Lab Sample I.D.	VBLKGD	972582A-05	VBLKGD	with no
Method Blank I.D.	VBLKGD	VBLKGD 1.00	25.0	Dilutio
Quant. Factor	1.00	1.00	25.0	DITUCIO
Chloromethane	υ	υ	υ	10
Bromomethane	U	U	U	10
Vinyl Chloride	U U	U U	υ	10
Chloroethane	U	U	U	10
Methylene Chloride	Ū	U U	ΰ	5.0
Acetone	10	U	120JB	10
Carbon Disulfide	U	υ	U	5.0
Vinyl Acetate	Ū	U	U	10
1,1-Dichloroethene	U	U	U	5.0
1,1-Dichloroethane	Ū	U	U	5.0
1,2-Dichloroethene (total)	Ū	U	400	5.0
Chloroform	Ū	U	76J	5.0
1,2-Dichloroethane	Ū	U	U	5.0
2-Butanone	Ū	U U	ប	10
1,1,1-Trichloroethane	Ū	Ū	U	5.0
Carbon Tetrachloride	Ū	Ū	U	5.0
Bromodichloromethane	Ū	Ū	U	5.0
1,2-Dichloropropane	U	Ū	U	5.0
cis-1,3-Dichloropropene	Ū	U	U	5.0
Trichloroethene	Ū	U	3000	5.0
Dibromochloromethane	υ	U	υ	5.0
1,1,2-Trichloroethane	Ū	Ū	U U	5.0
Benzene	Ū	U	l U	5.0
trans-1,3-Dichloropropene	Ŭ	Ū	Ū	5.0
Bromoform	Ū	Ū	U U	5.0
4-Methyl-2-Pentanone	Ŭ	U	Ū	10
2-Hexanone	Ŭ	Ū	Ū	10
Tetrachloroethene	Ŭ	Ū	120	5.0
Toluene	Ū	Ū	U	5.0
1,1,2,2-Tetrachloroethane	Ŭ	Ū Ū	Ū	5.0
Chlorobenzene	.5J	υ	Ū	5.0
Ethylbenzene	.6J	Ū	Ū	5.0
Styrene		Ū	Ū	5.0
Xylene (total)	Ū	Ū	U	5.0
			10/00/07	
Date Received		10/30/97	10/30/97	
Date Extracted	N/A	N/A	N/A	· ·
Date Analyzed	11/06/97	11/06/97	11/06/97	

See Appendix for qualifier definitions Note: Compound detection limit = quantitation limit x quantitation factor Quant. Factor = a numerical value which takes into account any variation in sample weight/volume, % moisture and sample dilution.

## TABLE VO-2.0 7097-2582A GOLDMAN ENVIRONMENTAL VOLATILE TENTATIVELY IDENTIFIED COMPOUNDS

Related Method Blank: VBLKDW

Lab Sample Id: VBLKDW Client Sample Id: Method Blank

CAS#	Compound	RT	Estimated Conc., ug/L
	NONE DETECTED		
	Lab Sample Id: 972582A-01 Client	Sample Id:	MW-2
CAS#	Compound	<u>RT</u>	Estimated Conc., ug/L
556-67-2	CYCLOTETRASILOXANE, OCTAMETH	20.58	15JN
	Lab Sample Id: 972582A-02 Client	Sample Id:	MW - 3
CAS#	Compound	RT	Estimated Conc., ug/L
	NONE DETECTED		
	Lab Sample Id: 972582A-03 Client	Sample Id:	MW-5
CAS#	Compound	RT	Estimated Conc., ug/L
556 <mark>-67-</mark> 2	CYCLOTETRASILOXANE, OCTAMETH	20.59	7 JN
	Lab Sample Id: 972582A-04 Client	Sample Id:	MW-7
CAS#	Compound		Estimated Conc., ug/L

13.03

20.58

30JN

11JN

See Appendix for qualifier definitions

PROPANE, 2-METHOXY-2-METHYL-CYCLOTETRASILOXANE, OCTAMETH

1634-04-4

556-67-2

## TABLE VO-2.1 7097-2582A GOLDMAN ENVIRONMENTAL VOLATILE TENTATIVELY IDENTIFIED COMPOUNDS

Related Method Blank: VBLKDZ

Lab Sample Id: VBLKDZ Client Sample Id: Method Blank

CAS#	Compound	RT	Estimated <u>Conc., ug/L</u>
	NONE DETECTED	*	
La	ab Sample Id: 972582A-0	7 Client Sample Id:	: MW-1
CAS#	Compound	RT	Estimated Conc., ug/L
	UNKNOWN SILOXANE	24.00	11J
Lab S	Sample Id: 972582A-08	Client Sample Id: TH	3 102997
CAS#	Compound	RT	Estimated Conc., ug/L
	NONE DETECTED		

### TABLE VO-2.2 7097-2582A GOLDMAN ENVIRONMENTAL VOLATILE TENTATIVELY IDENTIFIED COMPOUNDS

Related Method Blank: VBLKGD

Lab Sample Id: VBLKGD Client Sample Id: Method Blank

CAS#	Compound	RT	Estimated Conc., ug/L
	NONE DETECTED		30 -
	Lab Sample Id: 972582A-05	Client Sample Id:	: MW-9
CAS#	Compound		Estimated Conc., ug/L
	UNKNOWN SILOXANE	29.57	12J
	Lab Sample Id: 972582A-06	Client Sample Id:	MW-12
CAS#	Compound	RT	Estimated Conc., ug/L
	NONE DETECTED		<u></u>

## TABLE AS-1.0 7097-2582A GOLDMAN ENVIRONMENTAL PRIORITY POLLUTANT METALS

All values are ug/L.

Client Sample I.D.	MW-2	MW - 3	MW - 5	MW - 7
Lab Sample I.D.	972582A-01	972582A-02	972582A-03	972582A-04
Antimony	8.0U	8.00	8.00	8.00
Arsenic	53.0	29.8	3.00	72.4
Beryllium	3.7B	2.1B	1.0U	1.3B
Cadmium	1.00	1.00	1.00	1.00
Chromium	59.0	1440	46.7	124.
Copper	83.7	2170	142.	670.
Lead	58.2	48.4	5.6	22.2
Mercury	0.200	0.200	0.200	0.200
Nickel	53.8	3530	265.	250.
Selenium	5.9	4.0U	4.0U	4.00
Silver	1.00	1.00	1.00	1.00
Thallium	5.0U	5.OU	5.0U	5.00
Zinc	215.*	294.*	168.*	401.*

## TABLE AS-1.1 7097-2582A GOLDMAN ENVIRONMENTAL PRIORITY POLLUTANT METALS

All values are ug/L.

Client Sample I.D. Lab Sample I.D.	MW-9 972582A-05	MW-12 972582A-06	MW-1 972582A-07	MW-1 D 972582A-07D
Antimony	8.0U	8.00	8.0U	8.0U
Arsenic	11.2	5.4B	5.2B	3.00
Beryllium	1.00	1.00	1.00	1.00
Cadmium	1.00	1.00	1.00	1.00
Chromium	14.2	621.	4.6B	4.0B
Copper	14.9B	2160	6.4B	5.0B
Lead	6.2	10.2	2.00	2.6B
Mercury	0.200	0.200	0.200	0.200
Nickel	11.3B	8340	5.1B	3.1B
Selenium	4.00	4.00	4.0U	4.00
Silver	1.00	1.00	1.00	1.00
Thallium	5.00	5.00	5.0U	5.00
Zinc	181.*	703.*	31.6*	77.5*

## TABLE AS-1.2 7097-2582A GOLDMAN ENVIRONMENTAL PRIORITY POLLUTANT METALS

All values are ug/L.

Client Sample I.D.	MW-1 S		
Lab Sample I.D.	972582A-07S		
Antimony	494.		
Arsenic	43.8		
Beryllium	50.8		
Cadmium	4.9B		
Chromium	188.		
Copper	242.		
Lead	21.0		
Mercury	0.97		
Nickel	466.		
Selenium	10.4		
Silver	43.4		
Thallium	45.4		
Zinc	518.		

See Appendix for qualifier definitions

1

1

1 WET CHEM ANALYSIS DATA SHEET SAMPLE NO.

	4			MW-2	i
ab Name: IEA		Contract:		1 1 1 Y Y . 2 1 1	!
ab Code: IEA	Case No.: 25824	A SAS	No. :	SDG No.: A2582	
Matrix: (soil/water	) WATER		Lab Sample	ID: 2582001	
Solids:			Date Receiv	/ed: 10/30/97	

Concentration Units (mg/L or mg/kg dry weight) : mg/L

Analyte	Concentration	С	Q	M
CR-HEX	0.010	U	       	!! !!
			     	¦  ¦
			1 	!   !
			1 1 1 1	
		; ;	·	 
·		: : : :	1	 
		' ' '	1 1 3 1	 
			·	

omments:\_\_\_\_

1 WET CHEM ANALYSIS DATA SHEET SAMFLE NO.

				MW-3	
ab Name: IEA		Contract:		1 1	!
.ab Code: IEA	Case No.:	2582A SAS	No. :	SDG No.: A2582	
Matrix: (soil/wate	r) WATER		Lab Sample	ID: 2582002	
: Solids:			Date Receiv	ed: 10/30/97	

Concentration Units (mg/L or mg/kg dry weight) : mg/L

Analyte	Concentration	C	Q	: м : : м :
CR-HEX	0.010	U	······	 
		¦	·	 
		 	·	 
		·	· · · · · · · · · · · · · · · · · · ·	
		'   		
			·	
		¦		

Comments:

	1 WET CHEM ANALYSIS	DATA SHEET	SAMPLE NO.	
			ΜW-5	
.ab Name: IEA	Contr	ract:		
ab Code: IEA	Case No.: 2582A	SAS No. :	SDG No.: A2582	
Matrix: (soil/wate	er) WATER	Lab Sample	ID: 2582003	
Solids:		Date Recei	ved: 10/30/97	

Analyte	Concentration	C	Q	м
CR-HEX	0.010	: ; U !	·	; ;
				!
······		i	·	
		!	     	!
		·	·	
		¦	       	 
· · · · · · · · · · · · · · · · ·				

comments:

	1 Wet chem analy	SIS DATA	SHEET	SAMFLE NO.	
Lab Name: IEA		Contract:		MW7	1 1 1 1
.ab Code: IEA	Case No.: 2582A	SAS	No.::	SDG No.: A2582	
Matrix: (soil/wate	r) WATER		Lab Sample	ID: 2582004	
: Solids:			Date Receiv	/ed: 10/30/97	

Analyte	Concentration	   C 	Q	: M :
CR-HEX	0.010	! : U !		  `
		; ; ;		¦  
		: 		
· ·		1 1 1 1	· · · · · · · · · · · · · · · · · · ·	 
		: 	·	 
			·	 
۱ ۱ ۱			 	

\_Comments:\_\_\_\_

.....

	1 WET CHEM ANALYSI	IS DATA SHEET	SAMPLE NO.	
			MW-9	;
ab Name: IEA	Case No.: 2582A	SAS No. :	SDG No.: A2582	······································
Matrix: (soil/wate			ole ID: 2582005	
Solids:		Date Rec	ceived: 10/30/97	

Analyte	Concentration	С	Q	: M :
CR-HEX	0.010			¦   
·		· ·		 
· · · · · · · · · · · · · · · · · · ·		     		 
				!

	1 WET CHEM ANALYSIS	DATA	SHEET	SAMPLE NO.	
ab Nazza 750	Contr	<b>-</b> - + •		MW-12	
ab Name: IEA				1	······ '
ab Code: IEA	Case No.: 2582A	SAS	No. :	SDG No.: A2582	
Matrix: (soil/wate	r) WATER		Lab Sample	ID: 2582006	
Solids:			Date Receiv	ed: 10/30/97	

Analyte	Concentration		- Q	: M
CR-HEX	0.010	 U	·	! !
			·	
		·	       	1
 		; 	! !	
······				
· · · · · · · · · · · · · · · · · · ·		 		
·			 	
i i		; {	i	!

comments:\_\_\_\_\_

1 WET CHEM ANALYSIS DATA SHEET SAMPLE NO.

						MW-1	
	ab Name:	IEA		Contract		1	;
	ab Code:	IEA	Case No.:	2582A SAS	8 No. :	SDG No.: A2582	
1;	atrix: (	soil/wate	r) WATER		Lab Sample	ID: 2582007	
	Solids:				Date Receiv	ved: 10/30/97	

Concentration Units (mg/L or mg/kg dry weight) : mg/L

Analyte	Concentration		Q	: M :
CR-HEX	0.010		·	
		·	·	
I		 	·	 
}		! !	 	 
			i	

omments:\_\_\_\_\_

-	HET CHEM ANAL	1 YSIS DATA SHEET	SAMPLE NO.
	WET CHEM HNHL	TSIS DHIH SHEET	; : Μω-1
ab Name: IEA		Contract:	1 · · · · · · · · · · · · · · · · · · ·
ab Code: IEA	Case No.: 2582A	SAS No. :	SDG No.: A2582
Matrix: (soil/wate	r) WATER	Lab Sampl	e ID: 2582007D
Solids:		Date Rece	vived: 10/30/97

) 1

Concentration Units (mg/L or mg/kg dry weight) : mg/L

Analyte	Concentration		Q	M
CR-HEX	0.010			
		 		_
				_¦ _¦

jomments:

	1 Wet chem analys	IS NATA SHEET	SAMPLE NU.	
ж Ж	WET OTET ANALTS	TO DATA SILLI	! ! MW-1	:
ab Name: IEA	Co	ntract:		
ab Code: IEA	Case No.: 2582A	SAS No. :	SDG No.: A2582	
atrix: (soil/wate	r) WATER	Lab Sampl	e ID: 2582007S	
Solids:		Date Rece	ived: 10/30/97	

Analyte	Concentration	   C	Q	: M
CR-HEX	0.49	   	·	!
				;
		i i		 
·		 	 	¦
 		 		¦
		'   	·	;
		 	·	! !
			·	

comments:\_\_\_\_\_

## ORGANICS APPENDIX

U - Indicates that the compound was analyzed for but not detected.

- J Indicates that the compound was analyzed for and determined to be present in the sample. The mass spectrum of the compound meets the identification criteria of the method. The concentration listed is an estimated value, which is less than the specified minimum detection limit but is greater than zero.
- B This flag is used when the analyte is found in the blanks as well as the sample. It indicates possible sample contamination and warns the data user to use caution when applying the results of this analyte.
- N Indicates that the compound was analyzed for but not requested as an analyte. Value will not be listed on tabular result sheet.
- S Estimated due to surrogate outliers.
- X Matrix spike compound.
- Cannot be separated.
- (2) Decomposes to azobenzene. Measured and calibrated as azobenzene.
- A This flag indicates that a TIC is a suspected aldol condensation product.
- E Indicates that it exceeds calibration curve range.
- D This flag identifies all compounds identified in an analysis at a secondary dilution factor.
- C Confirmed by GC/MS.
- T Compound present in TCLP blank.
- P This flag is used for a pesticide/aroclor target analyte when there is a greater than 25 percent difference for detected concentrations between the two GC columns (see Form X).

# INORGANICS APPENDIX

# C - Concentration qualifiers

- U Indicates analyte was not detected at method reporting limit.
- B Indicates analyte result between IDL and contract required detection limit (CRDL)

# Q - QC qualifiers

- E Reported value is estimated because of the presence of interference
- M Duplicate injection precision not met
- N Spiked sample recovery not within control limits
- S The reported value was determined by the method of standard additions (MSA)
- W Post-digest spike recovery furnace analysis was out of 85-115 percent control limit, while sample absorbance was less than 50 percent of spike absorbance
- \* Duplicate analysis not within control limit
- + Correlation coefficient for MSA is less than 0.995

M - Method codes

- P ICP
- A Flame AA
- F Furnace AA
- CV Cold vapor AA (manual)
- C Cyanide
- NR Not Required
- NC Not Calculated as per protocols

# STATE CERTIFICATIONS

In some instances it may be necessary for environmental data to be reported to a regulatory authority with reference to a certified laboratory. For your convenience, the laboratory identification numbers for the AEN-Connecticut laboratory are provided in the following table. Many states certify laboratories for specific parameters or tests within a category (i.e. method 325.2 for wastewater). The information in the following table indicates the lab is certified in a general category of testing such as drinking water or wastewater analysis. The laboratory should be contacted directly if parameter-specific certification information is required.

State	Responsible Agency	Certification	Lab Number	
Connecticut	Department of Health Services	Drinking Water, Wastewater	PH-0497	
Maine	Department of Human Services	Wastewater	CT023	
Massachusetts	Department of Environmental Protection	Potable/Non-Potable CT023 Water		
New Hampshire	Department of Environmental Services	Drinking Water, 2528 Wastewater		
New Jersey	Department of Environmental Protection	Drinking Water, 46410 Wastewater		
New York	Department of Health	CLP, Drinking Water, Wastewater, Solid/ 10602 Hazardous Waste		
North Carolina	Division of Environmental Management	Wastewater 388 Hazardous Waste		
North Dakota	Department of Health and Consolidated Laboratories	Non-Potable/Potable R-138 Hazardous Waste		
Oklahoma	Department of Environmental Quality	General Water Quality/ 9614 Sludge Testing		
Rhode Island	Department of Health	ChemistryNon- Potable Water and A43 Wastewater		
Washington	Department of Ecology	Wastewater/ .C231 Hazardous Waste		
West Virginia	Division of Environmental Protection	Wastewater/ 263 Hazardous Waste		
Wisconsin	Department of Natural Resources	Wastewater/ 998355710 Hazarous Waste		

# AEN-Connecticut Certification Summary (as of September 1997)

## 7097-2582A GOLDMAN ENVIRONMENTAL SAMPLE SUMMARY

CLIENT ID	LAB ID	MATRIX	DATE COLLECTED	DATE RECEIVED
<b>M</b> ₩-2	972582A-01	WATER	10/29/97	10/30/97
MW-3	972582A-02	WATER	10/29/97	10/30/97
MM-5	972582A-03	WATER	10/29/97	10/30/97
<u>M</u> W - 7	972582A-04	WATER	10/29/97	10/30/97
4W-9	972582A-05	WATER	10/29/97	10/30/97
MW-12	972582A-06	WATER	10/29/97	10/30/97
MM-1	972582A-07	WATER	10/29/97	10/30/97
MW-1	972582A-07D	WATER	10/29/97	10/30/97
	972582A-07MS	WATER	10/29/97	10/30/97
MW-1	972582A-07MSB	WATER	10/29/97	10/30/97
MW-1	972582A-07MSD	WATER	10/29/97	10/30/97
MW-1	972582A-07S	WATER	10/29/97	10/30/97
102997	972582A-08	WATER	10/29/97	10/30/97

	<pre>Page:1</pre>
	<b>Client ID:</b> MW-1, MW-12, MW-2, MW-3, MW-5, MW-7, MW-9, TB 102997 Job Number: 7097-2582A
	Date: 11/25/97
-	Qty Matrix Analysis Description
	9 WATERCR6-NSW846Hexavalent Chromium9 WATERMET-NSW846-PPPri Pol Metals2 WATERVOA-N8260A-TCLTCL Volatile Organic1 WATERVOA-N8260A-TCL-10TCL Volatile Organic8 WATERVOA-N8260A-TCL-10TCL Volatile Organic
_	