

ORIGINAL TO COMMISSION

County _____

State of New York

Department of Conservation

Division of Water Power and Control

Well No. 3111
(See preliminary report)
LOG
Ground level, 31 ft. above sea level

COMPLETION REPORT - LONG ISLAND WELL

Owner W. H. R. - C. Hillville
Address W. H. R. - C. Hillville
Location of well 12411/12412 W. H. R. Station
Depth below surface 62 ft.

Depth to water: Ground water 42 ft.; Finished well 35 ft.

Casing:
Diameter 4" in. in. in. in.
Length 54 ft.
Sealing crack well packer
Casings removed _____

Screen: Make Cook Openings #20 slot
Diameter 4" in. in. in. in.
Length 4 ft.
Depth to top from top of casing 53-6 ft.

Pumping Test: Date Aug 2-52 Test or permanent pump? _____
Duration of Test 2 days _____ hours
Maximum Discharge 38 gallons per minute
Static Level Prior to Test 42 ft. in. below top of casing
Level during Max. Pumping 51 ft. in. below top of casing
Maximum Drawdown 9 ft.
Approx. time of return to normal level after cessation of pumping _____ hours _____ minutes

PUMP INSTALLED:
Type jet Make Cook Model No. _____
Motive power Electric Make Century H.P. 2 1/4
Capacity 28 g.p.m. against 40 lbs ft. of discharge head
No. of ~~stages~~ 1 ft. of total head

DROP LINE:
Diameter 2" x 4" in. in. in. in.
Length 45 ft.


Use of water water for irrigation
Work started Aug 10-52
Date 6-52 Driller W. H. R. - C. Hillville

License No. 202

Notes: (1) Log of well materials encountered with depth below ground surface.
(2) Bearing logs and water levels, etc., casing, screens, pump, etc.
(3) Pumping tests and other matters of interest. Describe repair job.
(4) Instructions as to Well Driller's License and Reports pp. 5-7

SSION
ED

SKETCH OF LOCATION

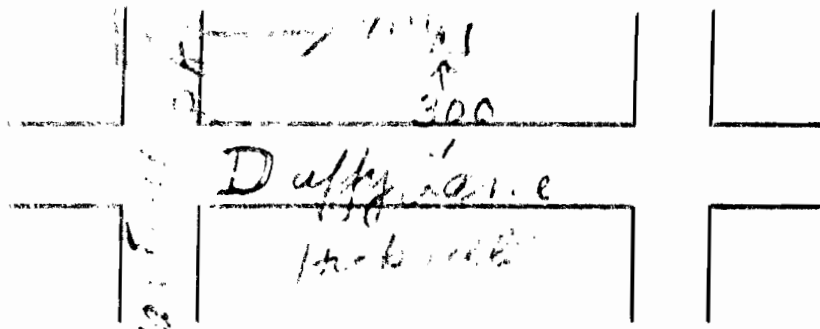

Locate well with respect to at least two streets or roads, showing distance from corner and front of lot.

Show North Point