

Project: Spectrum Finishing - Remedial Action
 Contractor: EnviroTrac Environmental Services
 CDM Job No: D-006956 Site No. 1-52-029
 CDM Project Manager: John Blaum

CDM
 100 Crossways Park West
 Woodbury, NY 11797
 Telephone: 516.496.8400
 Fax: 516.496.8864

DAILY REPORT

Day:

S	M	T	W	TH	F	S
---	---	---	---	----	---	---

 Date: 12-Mar-09
 REPORT No. 98
 PAGE No. 1

WEATHER	Clear	Partly Cloudy	Overcast	Rain	Snow
TEMP L/H		35/41			
HUMIDITY	Dry	Moderate	High		
WIND	Calm	Light	Moderate	High	
WIND DIR	N	E	S	W	
	NE	SE	SW	NW	

PREPARED BY: F.Robinson TITLE: Inspector

AVERAGE FIELD FORCE

Name of Contractor	Title	Hours Worked	Remarks
EnviroTrac	Construction manager	2x8 hrs	J.Szymanski, M.Rose
EnviroTrac	Operator	1x8hrs	J.Byrnes
EnviroTrac	Technician	3x8 hrs	R.Gimbel, K.Davies, R. Moletta
AARCO	Operator	2x8 hrs	M.Bonislawski, A.Sanchez
AARCO	Laborer	2x8 hrs	M.Mazur, J.Torres

EQUIPMENT AT THE SITE I = Idle W = Working

Daewoo 450 skidder - W	AARCO Guzzler Vac Truck - W
Case 590 Backhoe - I	AARCO Support Truck - W
Case 621D Front End Loader - W	CAT 301.5 mini-excavator - W
20' Storage Container - W	Case CX130 Excavator - W

HEALTH AND SAFETY

Name	Time (From - To)	Task/Level of PPE
		All workers onsite were in level D-PPE

CONSTRUCTION ACTIVITIES

Site Representative: Frank Robinson - CDM
Health and Safety Site Officer: N/A
DESCRIPTION OF WORK PERFORMED AND OBSERVED
1-Tailgate H&S meeting performed before the start of the work day. monitoring was performed with 3 monitoring stations, dust and PID's. 2- Air
3-AARCO continues to excavate the east alleyway from east to west by hand and vac truck along the gas line to a depth of ~3-4' bg. The gas line is being supported by pipe between the slabs of the 2 buildings at ~10' intervals.
4-EnviroTrac continues to excavate the east alleyway from the gas meter to the west to a depth of ~3-4' bg.
5-A contaminated concrete sample was collected. The pieces were selected by CDM and EnviroTrac, crushed into small pieces and then sent to the lab for waste characterization.
6-Approximately 50' of foundation wall of 50 Dale St. collapsed due to it being undercut during yesterday's excavation. Only about 5'-8' was undercut significantly and that was enough to collapse the wall. There doesn't appear to be any rebar or wire in the slab or wall or in the connection between the wall and slab. The excavation next to 40 Dale St. was sloped and is stable.

x - Designates report is continued on additional pages

CDM Site Representative: F. Robinson Project Manager: John Blaum

PHOTOGRAPHIC LOG

Date: 03/12/09

CDM Job No. D-006956

Spectrum Finishing Remedial Action

SITE No. 1-52-029

PHOTO	DATE	TIME	DESCRIPTION
100_0108.jpg	3/12/2009	AM	Green staining along north wall of east alleyway
100_0110.jpg	3/12/2009	AM	Excavating east alleyway
100_0111.jpg	3/12/2009	AM	Crack separating 50 Dale St. slab from wall
100_0112.jpg	3/12/2009	AM	Undercutting of wall along east alleyway
100_0115.jpg	3/12/2009	AM	Collapse of south wall of 50 Dale St.
100_0116.jpg	3/12/2009	PM	Excavation of east alleyway, gas line supported every ~10'

PHOTOS 3/12/09



100_00108.jpg - Green staining along north wall of east alleyway



100_0110.jpg - Excavating east alleyway.



100_0111.jpg - Crack separating 50 Dale St. slab from wall.




100_112.jpg - Undercutting of wall along east alleyway



100_115.jpg - Collapse of south wall of 50 Dale St.



100_116.jpg - Excavation of east alleyway, gas line being supported at ~10 intervals.

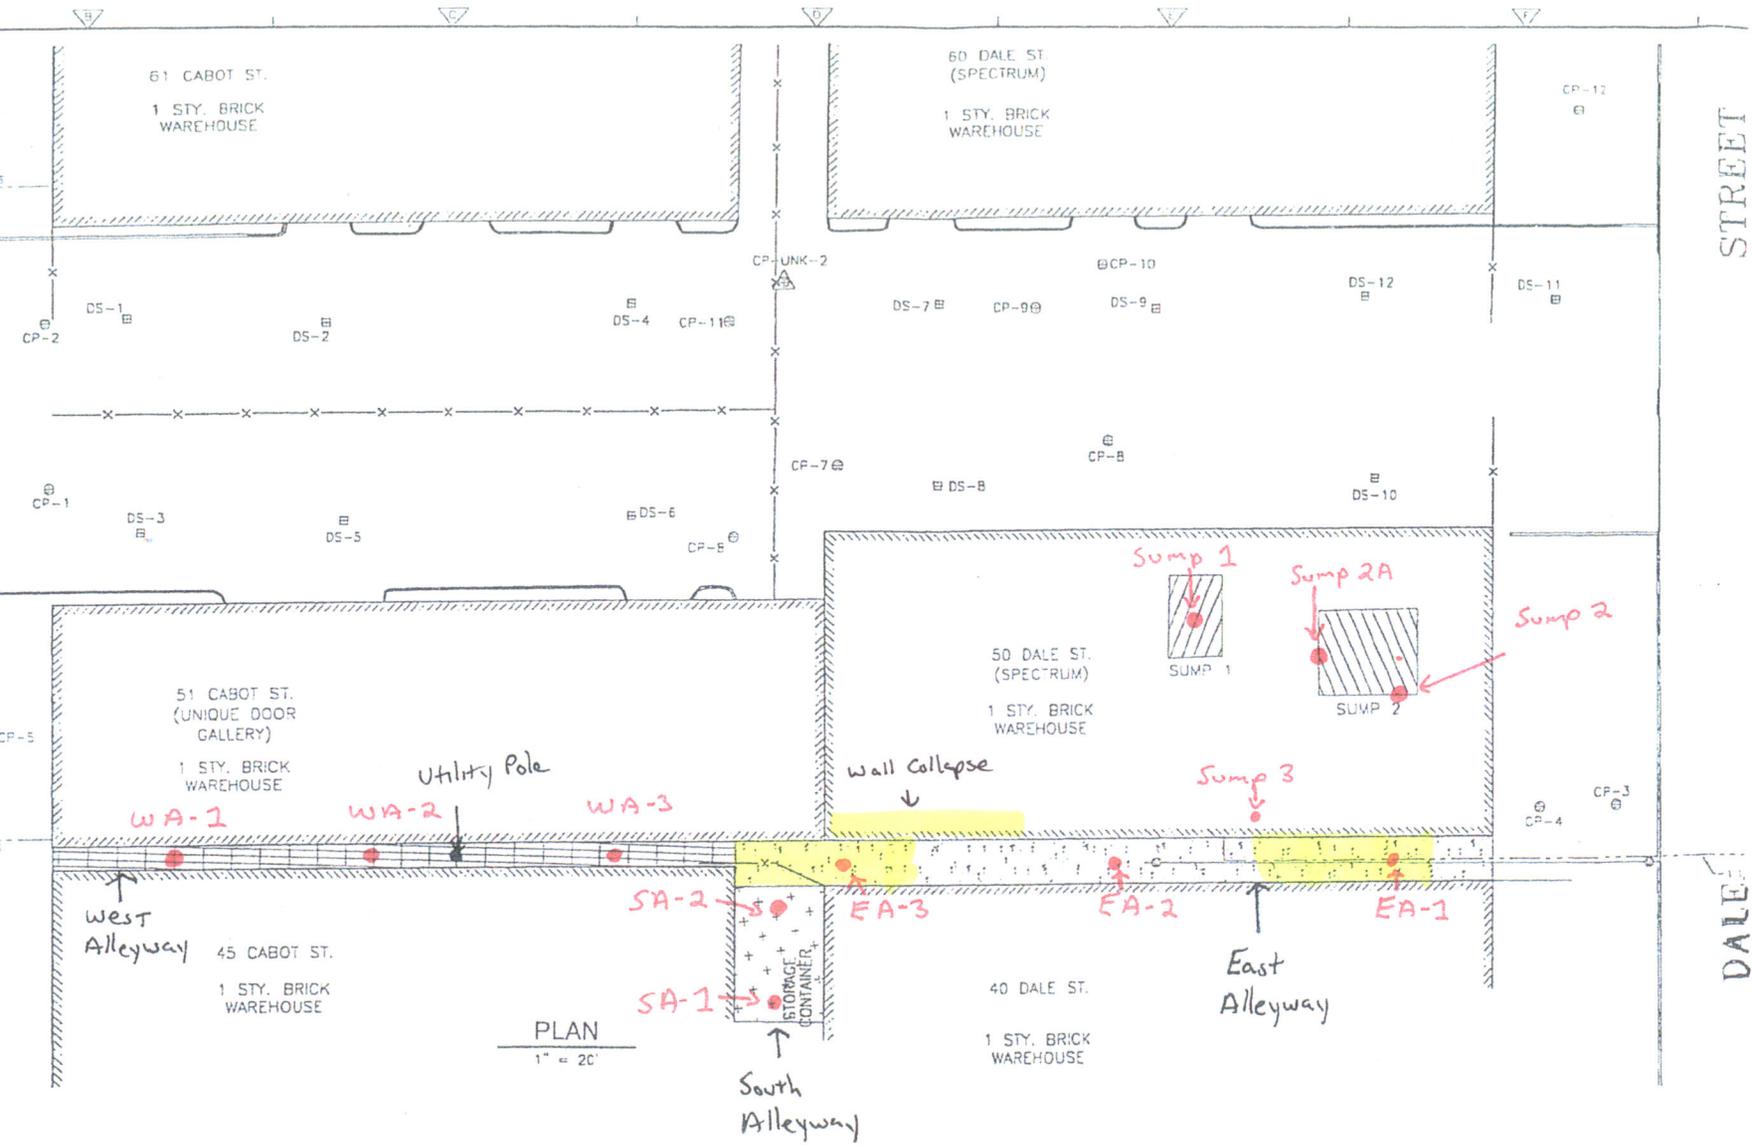

3/12/09

Work Areas

Spectrum Sample Locations

Note: Sump # 2 was not sampled

EnviroTrac Ltd.
 DEC FIELD REPORT: TIME & MATERIALS REPORT (revised 3/5/09)

DATE: 3/12/09
 WORK DAY: Thursday
 CLIENT: NYSDEC
 SITE: Spectrum Finishing

T&M#:
 HRCO 3/12/09
 JR
 MK

WORK DESCRIPTION: East Alley Excavation - Eastern portion around gas line

Name	Title	Time Start	Time Arrive Onsite	Time Left Site	Time Finish	Overtime	Total Time
Michael Boniskaski	Eg Op		7	3			8
Juan Torres	Eg Op		7	3			8
Michael Mazur	Laborer		7	3			8
Andres A. Sanchez	Laborer		7	3			8
			7	3			

MATERIALS: RECEIPTS/BILLS ATTACHED
 UNIT COSTS: Reg. - Regular Time Ovr. - Overtime Hours

Unit Description	Hourly Rate	Reg Hrs	Ovr. time	Materials/Equipment Description	Daily Rate	Day	Materials/Equipment Description	Day
Equipment Operator	\$74.44	16		Automobiles - Sedans	\$110.00		Guzzler Truck	1
Laborer	\$51.88	16		Light Duty Vehicles (Less Than 1 Ton)	\$130.00		Vac Truck	
Foreman	\$105.00			Heavy Duty Vehicles (1 Ton or More)	\$150.00		Vactor Jet Truck	
Engineer	\$105.00			Skid Steer	\$320.00		Air Monitoring Equipment	
				Backhoe		1	Decon Equipment	
				Excavator Mini		1	Generator Min. 5KW	
				Front End Loader			Air Compressor Min. 200cfm	
				Support Truck		1		

