

Project: Spectrum Finishing - Remedial Action
 Contractor: EnviroTrac Environmental Services
 CDM Job No: D-006956 Site No. 1-52-029
 CDM Project Manager: John Blaum

CDM
 100 Crossways Park West
 Woodbury, NY 11797
 Telephone: 516.496.8400
 Fax: 516.496.8864

DAILY REPORT

Day:

S	M	T	W	TH	F	S
---	---	---	---	----	---	---

 Date: 13-Mar-09
 REPORT No. 99
 PAGE No. 1

WEATHER	Clear	Partly Cloudy	Overcast	Rain	Snow
TEMP L/H		26/38			
HUMIDITY	Dry	Moderate	High		
WIND	Calm	Light	Moderate	High	
WIND DIR	N	E	S	W	
	NE	SE	SW	NW	

PREPARED BY: F.Robinson TITLE: Inspector

AVERAGE FIELD FORCE

Name of Contractor	Title	Hours Worked	Remarks
EnviroTrac	Construction manager	1x8 hrs	M.Rose
EnviroTrac	Operator	1x8hrs	J.Byrnes
EnviroTrac	Technician	1x8 hrs	K.Davies
AARCO	Operator	2x8 hrs	M.Bonislawski, A.Sanchez
AARCO	Laborer	2x8 hrs	M.Mazur, J.Torres

EQUIPMENT AT THE SITE I = Idle W = Working

Daewoo 450 skidder - W	AARCO Guzzler Vac Truck - W
Case 590 Backhoe - I	AARCO Support Truck - W
Case 621D Front End Loader - W	CAT 301.5 mini-excavator - W
20' Storage Container - W	Case CX130 Excavator - W
	Komatsu PC78MR Excavator with hammer - W

HEALTH AND SAFETY

Name	Time (From - To)	Task/Level of PPE
		All workers onsite were in modified level D-PPE (tyvek and booties)

CONSTRUCTION ACTIVITIES

Site Representative: Frank Robinson - CDM
Health and Safety Site Officer: N/A
DESCRIPTION OF WORK PERFORMED AND OBSERVED
1-Tailgate H&S meeting performed before the start of the work day. monitoring was performed with 3 monitoring stations, dust and PID's. 2- Air
3-AARCO and EnviroTrac finished excavating the east alleyway with the vac truck excavating the gas line and the tracked excavator removing the rest. Left most of the soil around the utility pole, did not know how deep it was installed. Breaking up and removing collapsed concrete wall from 50 Dale St.
4-Soil sample collection (all TAL metals using 1 8 oz jar):West alleyway:WA-4 and WA-4A (Duplicate) 16' west of WA-3; WA-5 12' east of WA-2 with some green material in the sample. No visible contamination in excavation. East alleyway sampling, distances are the east wall of 51 Cabot St.: EA-4 (140') (MS/MSD), EA-sidewall 1 sample taken on south wall of green material 1' bg (109') EA-sidewall 2 sample taken on south wall of green material 1' bg (71') EA-5 (67') EA-6 (42') EA-7 (14')
5-Installed filter fabric at the bottom of the east and west alleyways excavations.
6-All vehicles that were working in the exclusion zone were decontaminated: guzzler vac truck(also hoses and interior of tank), Komatsu, mini-excavator and backhoe.



x - Designates report is continued on additional pages

CDM Site Representative: F. Robinson

Project Manager: John Blaum

PHOTOGRAPHIC LOG

Date: 03/13/09

CDM Job No. D-006956

Spectrum Finishing Remedial Action

SITE No. 1-52-029

PHOTO	DATE	TIME	DESCRIPTION
100_0117.jpg	3/13/2009	AM	50 Dale St. collapsed concrete wall being removed
100_0119.jpg	3/13/2009	AM	Excavating east alleyway with vac truck
100_0120.jpg	3/13/2009	PM	Filter fabric on west alleyway excavation. Flags are sample location, looking
100_0122.jpg	3/13/2009	PM	Filter fabric on east alleyway excavation, looking east
100_0123.jpg	3/13/2009	PM	Filter fabric on east alleyway excavation, looking east
100_0124.jpg	3/13/2009	PM	Decontamination of backhoe

PHOTOS 3/13/09



100_00117.jpg - 50 Dale St. collapsed concrete wall being removed.



100_0119.jpg - Excavating east alleyway with vac truck.



100_0120.jpg - Filter fabric on west alleyway excavation. Flags are sample locations, looking west.




100_122.jpg - Filter fabric on east alleyway excavation, looking east.



100_123.jpg - Filter fabric on east alleyway, looking east.



100_124.jpg - Decontamination of backhoe.

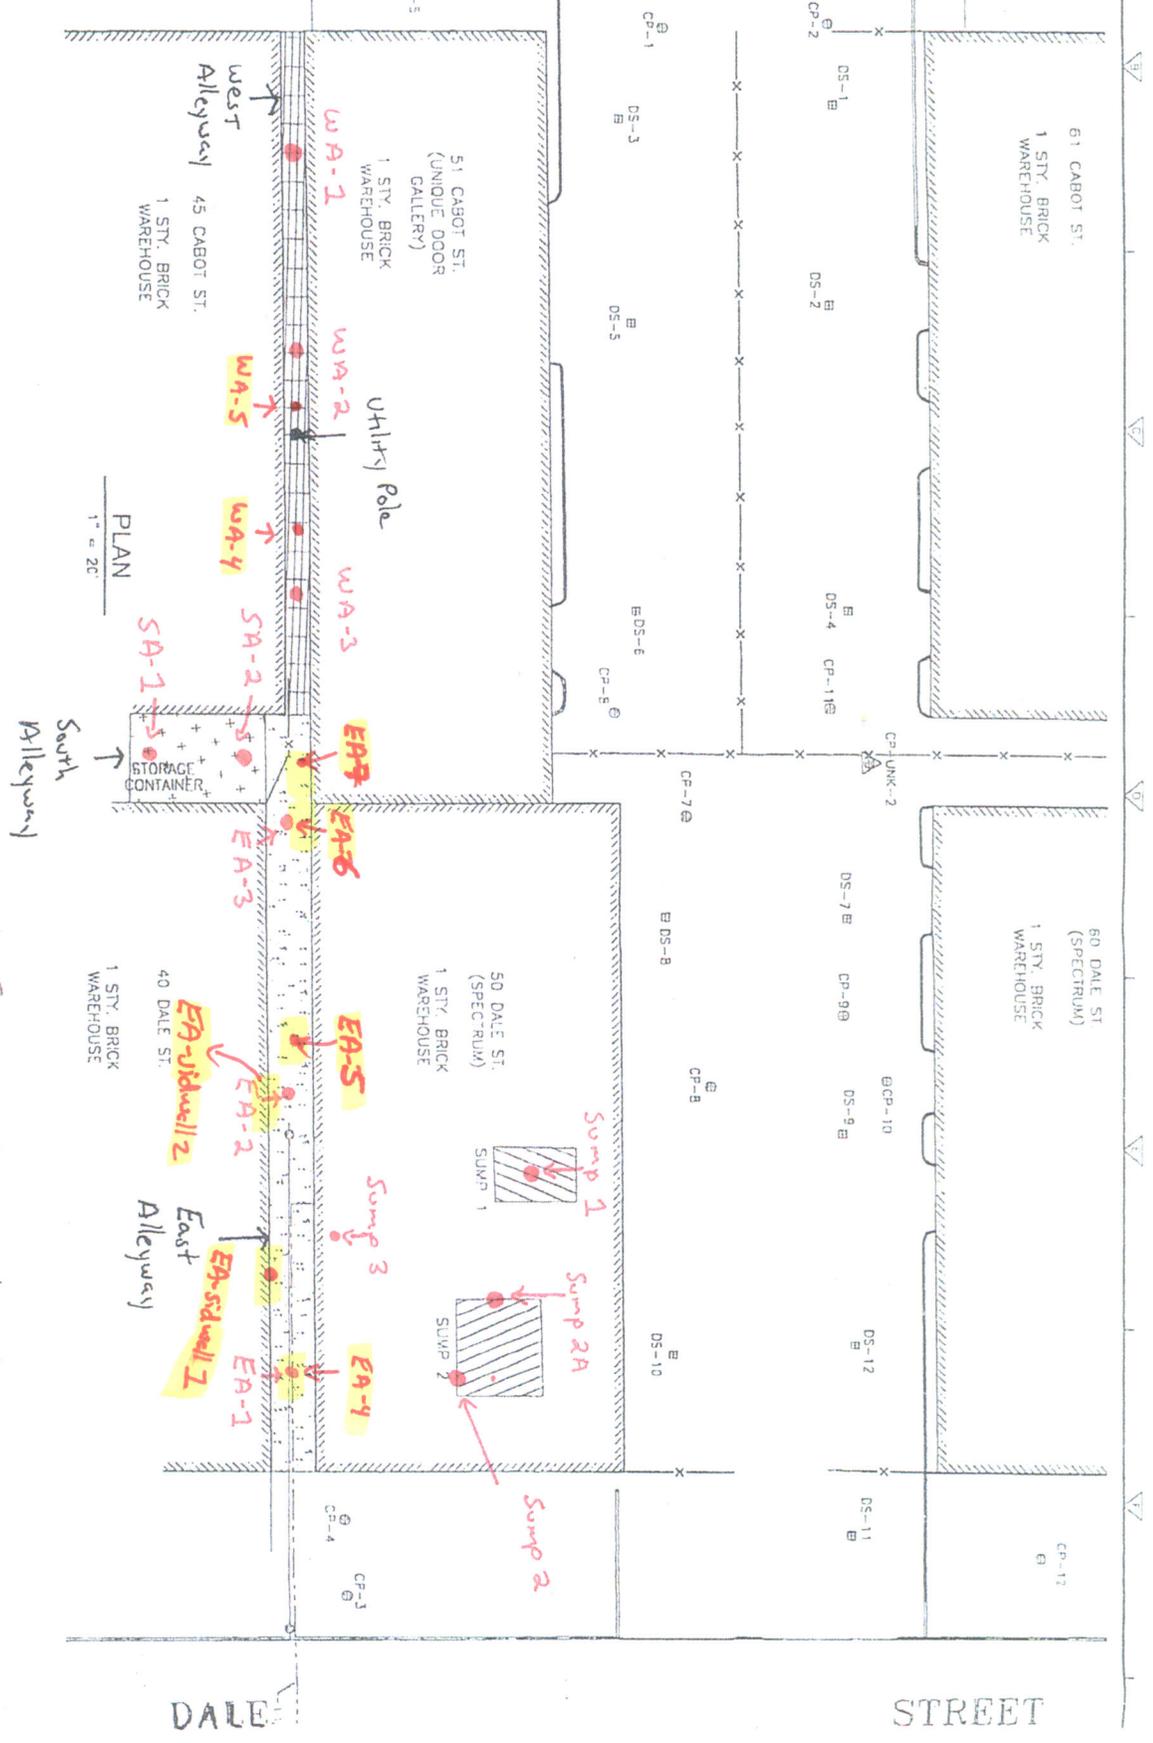

3/13/09
Work Areas

Spectrum Sample Locations
Note: Sump # 2 was not sampled

EnviroTrac Ltd.
 DEC FIELD REPORT: TIME & MATERIALS REPORT (revised 3/5/09)

DATE: 3/13/09
 WORK DAY: Friday

SITE: Spectrum Finishing

CLIENT: NYSDEC

T&M#: AMC03/13/09

WORK DESCRIPTION: East Alley Excavation

Name	Title	Time Start	Time Arrive Onsite	Time Left Site	Time Finish	Overtime	Total Time
<i>Michael Bonslawski</i>	<i>Exp Op</i>		<i>6</i>	<i>2</i>			<i>8</i>
<i>Juan Torres</i>	<i>Laborer</i>						
<i>Andres Syles</i>	<i>Exp Op</i>						
<i>Michael Moran</i>	<i>Laborer</i>						

MATERIALS: RECEIPTS/BILLS ATTACHED
 UNIT COSTS: Reg Regular Time Ovr - Overtime Hours

Unit Description	Hourly Rate	Reg Hrs	Ovr. time	Materials/Equipment Description	Daily Rate	Day	Materials/Equipment Description	Day
Equipment Operator	\$74.44	16		Automobiles - Sedans	\$110.00		Guzzler Truck	1
Laborer	\$51.88	16		Light Duty Vehicles (Less Than 1 Ton)	\$130.00		Vac Truck	
Foreman	\$105.00			Heavy Duty Vehicles (1 Ton or More)	\$150.00		Vactor Jet Truck	
Engineer	\$105.00			Skid Steer	\$320.00		Air Monitoring Equipment	
				Backhoe		1	Decon Equipment	
				Excavator <i>Mini</i>		1	Generator Min. 5KW	
				Front End Loader			Air Compressor Min. 200cfm	
				<i>Support truck</i>		1		

