

Weekly Report No.: 113

Period: 10/07/24 through 10/13/24

FILE NO: 03.0034060.10

This Weekly Air Monitoring Report summarizes perimeter air monitoring data collected during the referenced period in accordance with the Community Air Monitoring Plan (CAMP) which was included as part of the NYSDEC approved Remedial Action Work Plan for the Former Fulton Manufactured Gas Plant (MGP) Site – Parcel III and Portion of Parcel IV.

CAMP Monitoring Approach

Air monitoring was performed during the reporting period in accordance with the CAMP. Air Monitoring location for the reporting period is shown on **Figure 1.** The air monitoring program consists of:

- Monitoring for total volatile organic compounds (TVOCs) and airborne particulate dust (PM₁₀) concentrations is being conducted at five air monitoring stations (AMS-1 through AMS-5) around the perimeter of the Site.
- The program includes compound-specific monitoring for benzene and tri-chloroethylene (TCE) if the TVOC concentration is greater than the alert level at the air monitoring station.
- Monitoring of weather conditions.
- Periodic monitoring for TVOCs and PM₁₀ along Degraw Street using handheld equipment.
- Periodic observational monitoring for MGP-related odors and visible dust around the perimeter of the Site.

Action and Alert levels for monitored parameters are included in Table 1.

Air Monitoring Summary

During the reporting period, GZA collected air monitoring data consisting of TVOC and PM_{10} concentrations with the five air monitoring stations and using handheld instruments along Degraw Street. GZA also conducted observational monitoring for MGP-related odors and visible dust around the perimeter of the Site.

There were no TVOCs or PM_{10} concentrations above the CAMP-established action levels during the reporting period. Figures 2 and Figure 3 summarize the TVOC and PM_{10} concentrations, respectively, recorded during the reporting period.

Table 2 summarizes the observational monitoring for MGP-related dust and odors during the reporting period.

Daily Monitoring Reports 784 through 790 are attached and provide detailed information regarding air monitoring results and Site activities for each day during the reporting period.

Attachments:

Daily Monitoring Reports 784 through 790




Weekly Report No.: 113

Period: 10/07/24 through 10/13/24

FILE NO: 03.0034060.10

Figure 1 – CAMP Station Locations

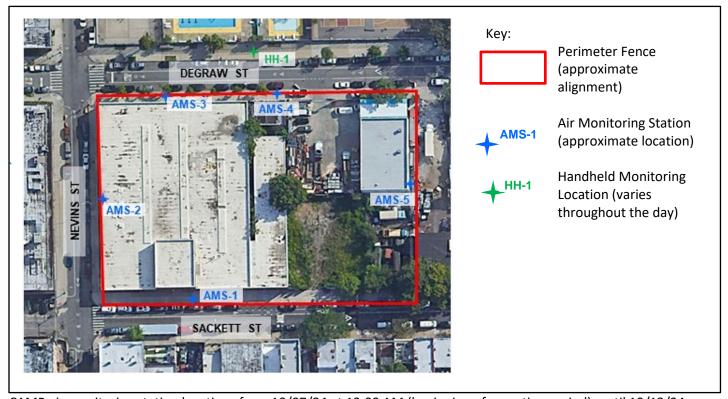


CAMP air monitoring station locations from 10/07/24 at 12:00 AM (beginning of reporting period), until 10/13/24 at 11:59 PM (end of reporting period).



Period: 10/07/24 through 10/13/24

FILE NO: 03.0034060.10

Figure 2 – Summary of TVOC, Benzene, and Tri-chloroethylene Concentrations 10/07/24 through 10/13/24

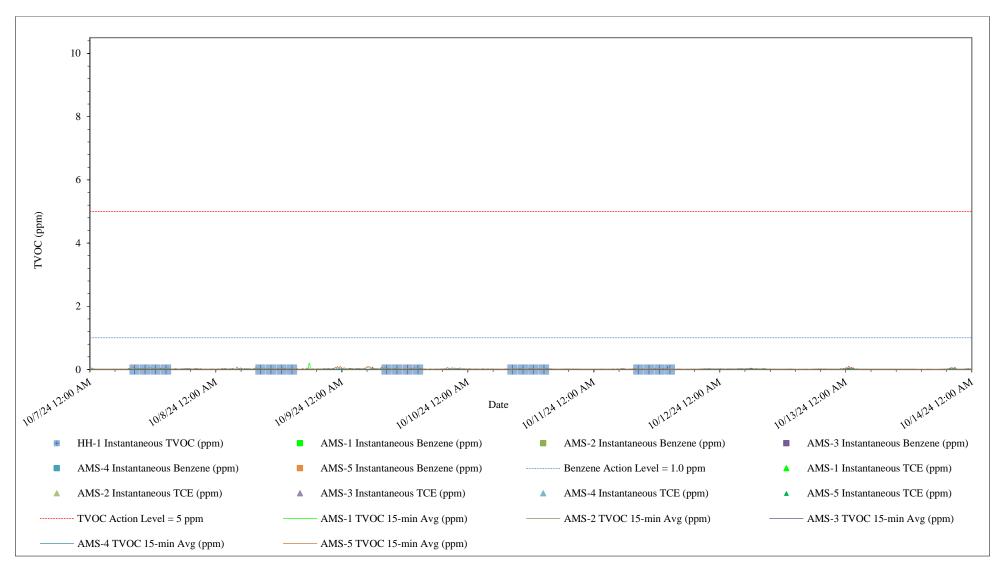


Weekly Report No.: 113



Period: 10/07/24 through 10/13/24

FILE NO: 03.0034060.10

Figure 3 – Summary of PM₁₀ Concentrations 10/07/24 through 10/13/24

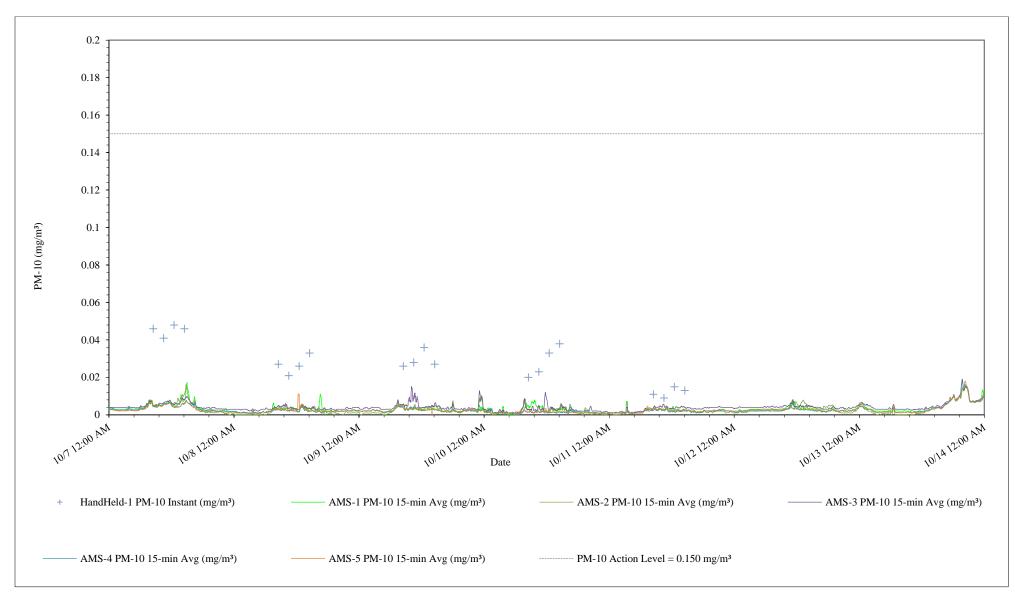

Weekly Report No.: 113



Period: 10/07/24 through 10/13/24

FILE NO: 03.0034060.10

TABLE 1 – ALERT AND ACTION LEVELS

Parameter	Basis of Measurement	Alert Level	Action Level
Total Volatile Organic Compounds (TVOCs)			5.0 ppm above background
Benzene	Instantaneous Concentration	0.5 ppm	1.0 ppm above background
Particulate Dust (PM ₁₀)	Particulate Dust (PM ₁₀) 15-minute TWA		0.150 mg/m³ above background
	Visible Observation	N/A	Visible Dust Leaving Site
MGP-Related Odors	Intensity	N/A	3

Notes:

- 1. ppm: parts per million
- 2. N/A: not applicable
- 3. TWA: Time-weighted average
- 4. Odor intensity is measured on an eight-point n-butanol scale, as adapted from ASTME E544.

TABLE 2 – SUMMARY OF WORKDAY ODOR AND VISIBLE DUST MONITORING

Date	Nuisance Odors (Yes/No)	Visible Dust (Yes/No)	Notes
10/07/24	No	No	-
10/08/24	No	No	-
10/09/24	No	No	-
10/10/24	No	No	-
10/11/24	No	No	-

Notes:

1. Observations made during working hours only around the perimeter of the Site.



DATE: 10/07/24


FILE NO: 03.0034060.10

This Daily Air Monitoring Report summarizes perimeter air monitoring data collected during the referenced period in accordance with the Community Air Monitoring Plan (CAMP) which was included as part of the NYSDEC approved Remedial Action Work Plan for the Former Fulton Manufactured Gas Plant (MGP) Site – Parcel III and Portion of Parcel IV. Note: the information included in this daily summary is based on preliminary results and is subject to change based on data validation.

Reporting Period:	Monday, October 7, 2024					
Weather	Temperature: 60.60 – 77.50°F	Preci	pitation: 0.00 in	Relative Humidity: 59.43%		
	Wind Speed: 0.41 – 5.50 mph		Prevailing Wind Direct	tion: NW		
Concentrations detected	AMS-1: None		AMS-4: None			
above the Action Level	AMS-2: None		AMS-5: None			
	AMS-3: None		HH-1 (handheld readi	ngs along Degraw St): none		
Summary of Site	GZA continued CAMP monito	ring 2	4 hours per day.			
Activities	CEI imported 17 truckloads of	of gen	eral fill and placed in th	ne completed portion of		
	Parcel IV cofferdam.					
	 CEI continued removing the P 	arcel	V holder and operated	the VMS.		
	 CEI operated the water treat 	ment	system and American	Dewatering & Grouting		
	(ADG) operated the Parcel IV	dewa	atering system.			
	CEI refueled equipment and	perfo	rmed general houseke	eping.		
	 ENTACT continued mobilizat 	ion of	ISS equipment, setting	g up the Batch Plant and		
	constructed a decontamination pad.					
Community Inquiries	None					
Other	Charles Lambert (WSP) visited the Site.					
	 Mat Frankel (Langan) visited t 	he Sit	e.			

Figure 1 - CAMP Station Locations



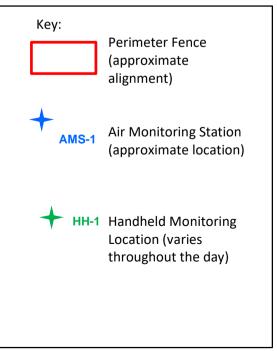

Daily Report No.: 784



DATE: 10/07/24 Daily Report No.: 784

FILE NO: 03.0034060.10

TABLE 1 – OFFSITE HANDHELD AIR MONITORING DATA

DATE	TIME	LOCATION	TVOC	PM ₁₀	NOTES
			ppm	mg/m³	
10/07/2024	8:30 AM	HH-1	0.0	0.011	-
10/07/2024	10:30 AM	HH-1	0.0	0.017	-
10/07/2024	12:30 PM	HH-1	0.0	0.018	-
10/07/2024	2:30 PM	HH-1	0.0	0.023	-

TABLE 2 - ODOR AND VISIBLE DUST MONITORING LOG

DATE	TIME	NUISANCE ODORS (YES/NO)	VISIBLE DUST (YES/NO)	NOTES
10/07/2024	8:30 AM	NO	NO	-
10/07/2024	10:30 AM	NO	NO	-
10/07/2024	12:30 PM	NO	NO	-
10/07/2024	2:30 PM	NO	NO	-


Attachments:

Daily Data Summary – Air Monitoring Stations 1 through 5


Prepared by: Geder Mena Reviewed by: Dan Amate

Construction Manager II Associate Principal

Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

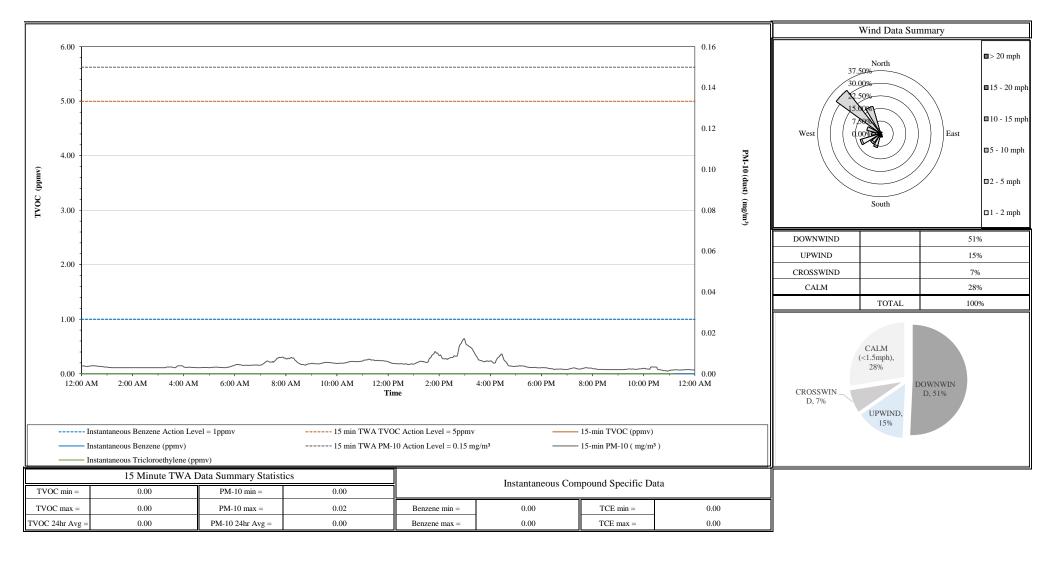


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

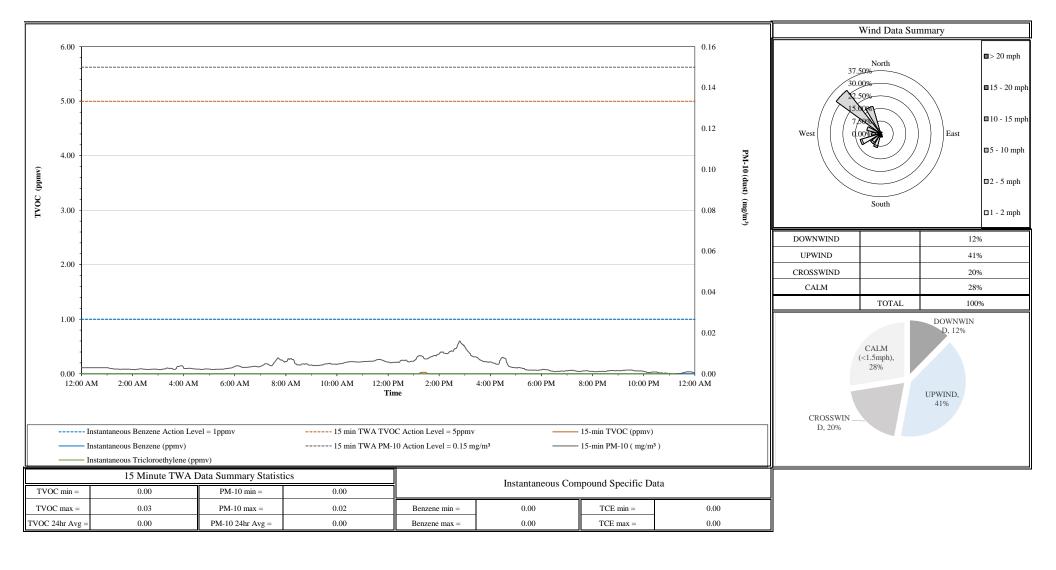


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY


AMS 3

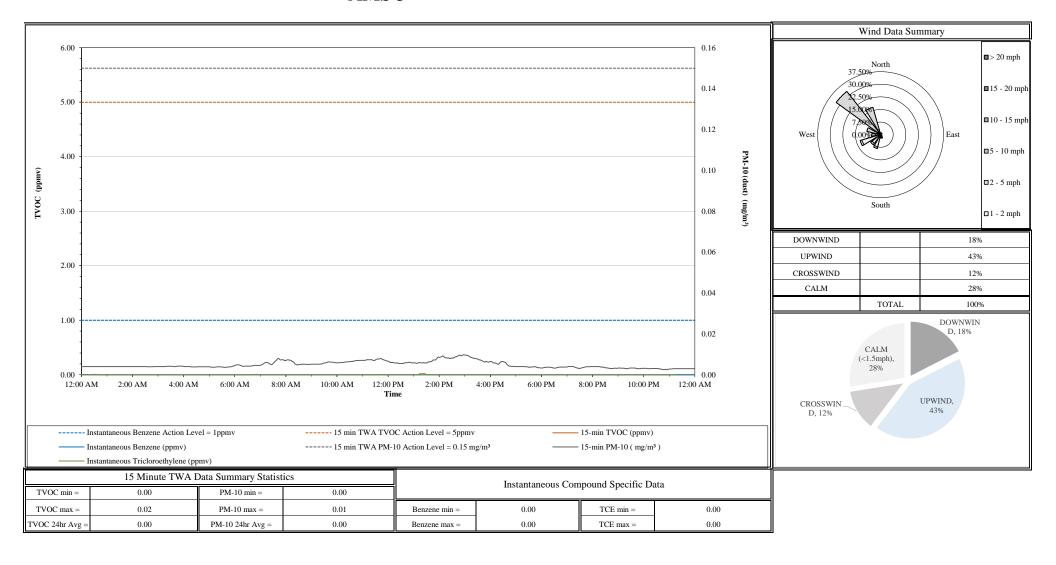

Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

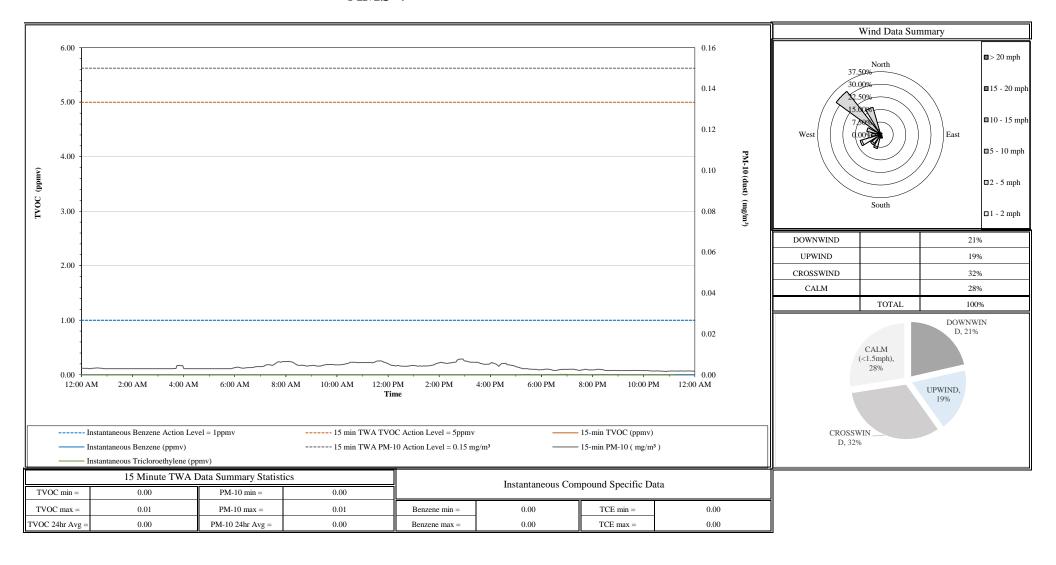

Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

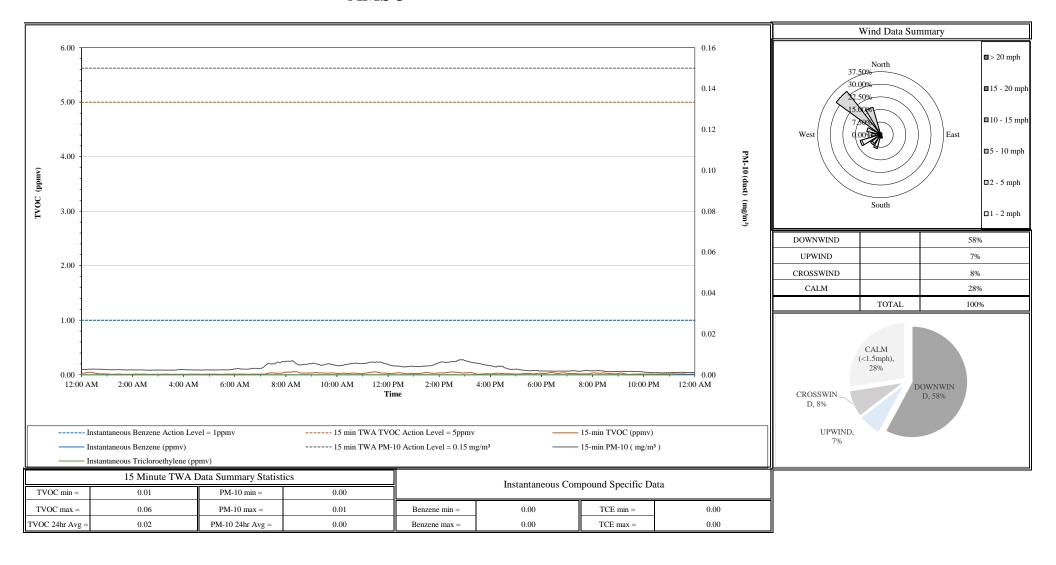



DATE: 10/08/24


FILE NO: 03.0034060.10

This Daily Air Monitoring Report summarizes perimeter air monitoring data collected during the referenced period in accordance with the Community Air Monitoring Plan (CAMP) which was included as part of the NYSDEC approved Remedial Action Work Plan for the Former Fulton Manufactured Gas Plant (MGP) Site – Parcel III and Portion of Parcel IV. Note: the information included in this daily summary is based on preliminary results and is subject to change based on data validation.

Reporting Period:	Tuesday, October 8, 2024					
Weather	Temperature: 55.20 – 71.60°F F	reci	oitation: 0.00 in	Relative Humidity: 48.82%		
	Wind Speed: 0.27 – 4.65 mph		Prevailing Wind Direct	ction: WNW		
Concentrations detected	AMS-1: None		AMS-4: None			
above the Action Level	AMS-2: None		AMS-5: None			
	AMS-3: None		HH-1 (handheld read	ings along Degraw St): none		
Summary of Site	GZA continued CAMP monitori	ng 24	hours per day.			
Activities	CEI transported 12 truckloads	of no	on-hazardous soil to 0	Clean Earth of Southeast		
	Pennsylvania for treatment.					
	CEI continued removing the Par	cel I	V holder and operated	the VMS.		
	CEI operated the water treatm	ent	system and American	Dewatering & Grouting		
	(ADG) operated the Parcel IV o	lewa	tering system.			
	CEI refueled equipment and per	erfor	med general houseke	eeping.		
	 ENTACT continued mobilizatio 	n of	ISS equipment and m	aterials and setting up the		
	Batch Plant.					
Community Inquiries	None					
Other	Charles Lambert (WSP) visited the Site.					
	Mat Frankel (Langan) visited the Site.					

Figure 1 - CAMP Station Locations



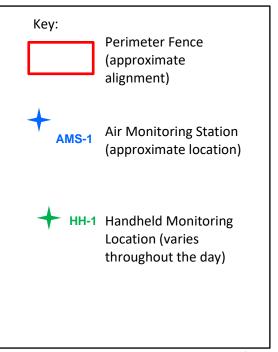

Daily Report No.: 785



DATE: 10/08/24 Daily Report No.: 785

FILE NO: 03.0034060.10

TABLE 1 – OFFSITE HANDHELD AIR MONITORING DATA

DATE	TIME	LOCATION	TVOC	PM ₁₀	NOTES
			ppm	mg/m³	
10/08/2024	8:30 AM	HH-1	0.0	0.027	-
10/08/2024	10:30 AM	HH-1	0.0	0.021	-
10/08/2024	12:30 PM	HH-1	0.0	0.026	-
10/08/2024	2:30 PM	HH-1	0.0	0.033	-

TABLE 2 – ODOR AND VISIBLE DUST MONITORING LOG

DATE	TIME	NUISANCE ODORS (YES/NO)	VISIBLE DUST (YES/NO)	NOTES
10/08/2024	8:30 AM	NO	NO	-
10/08/2024	10:30 AM	NO	NO	-
10/08/2024	12:30 PM	NO	NO	-
10/08/2024	2:30 PM	NO	NO	-


Attachments:

Daily Data Summary – Air Monitoring Stations 1 through 5


Prepared by: Geder Mena Reviewed by: Dan Amate

Construction Manager II Associate Principal

Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

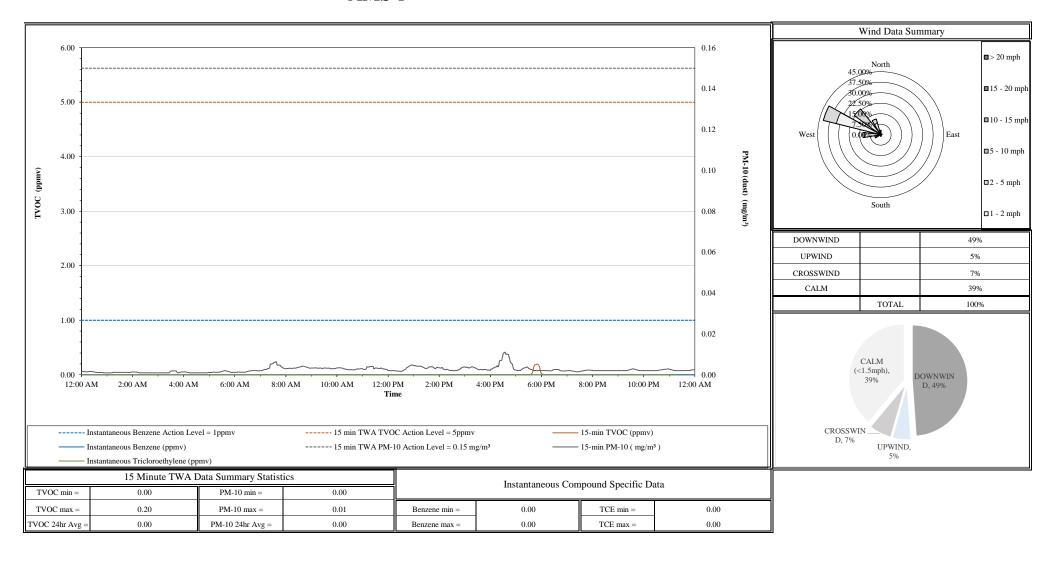


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

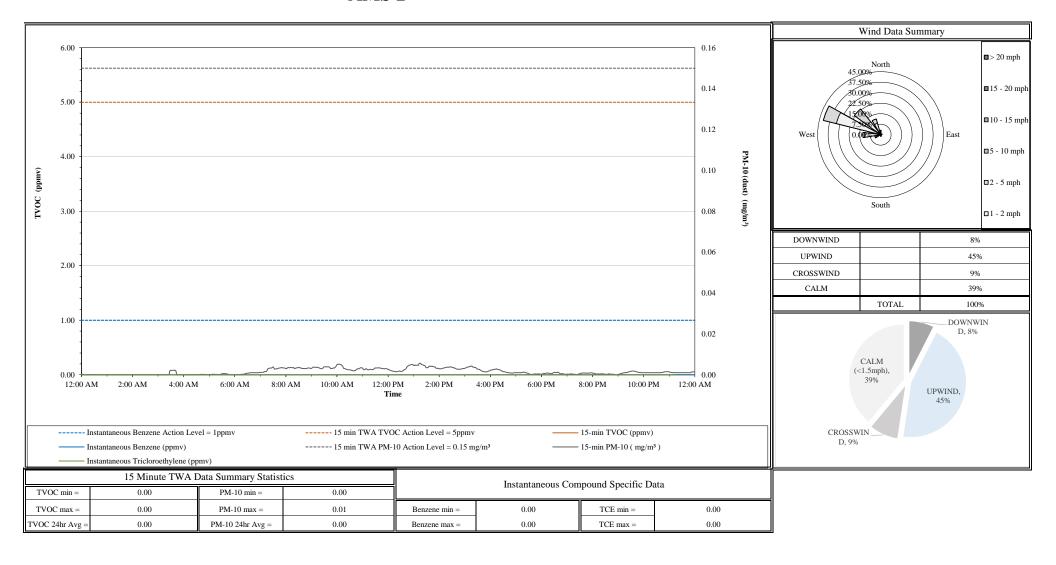


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

AMS 3

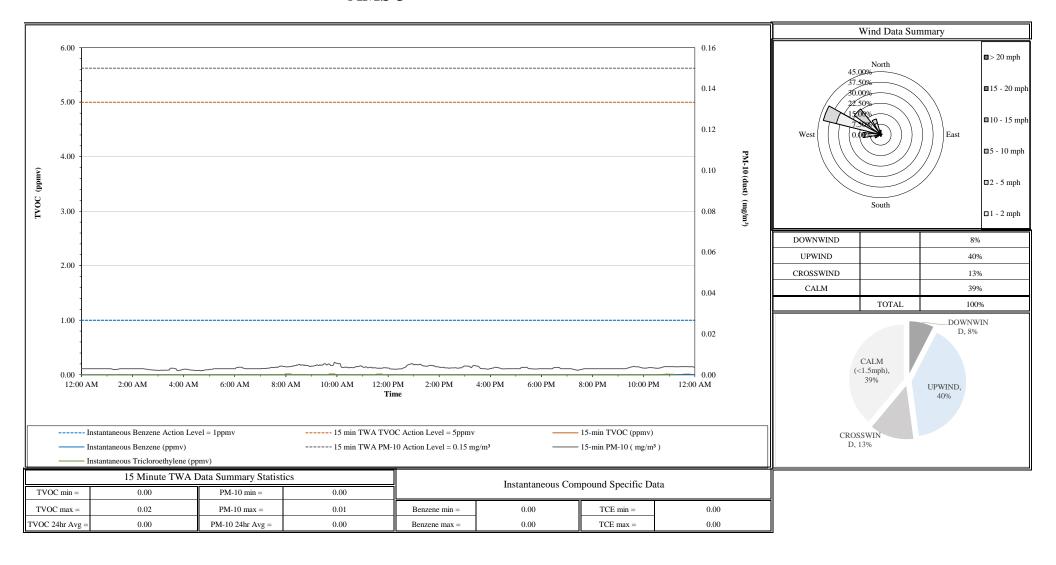


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

AMS 4

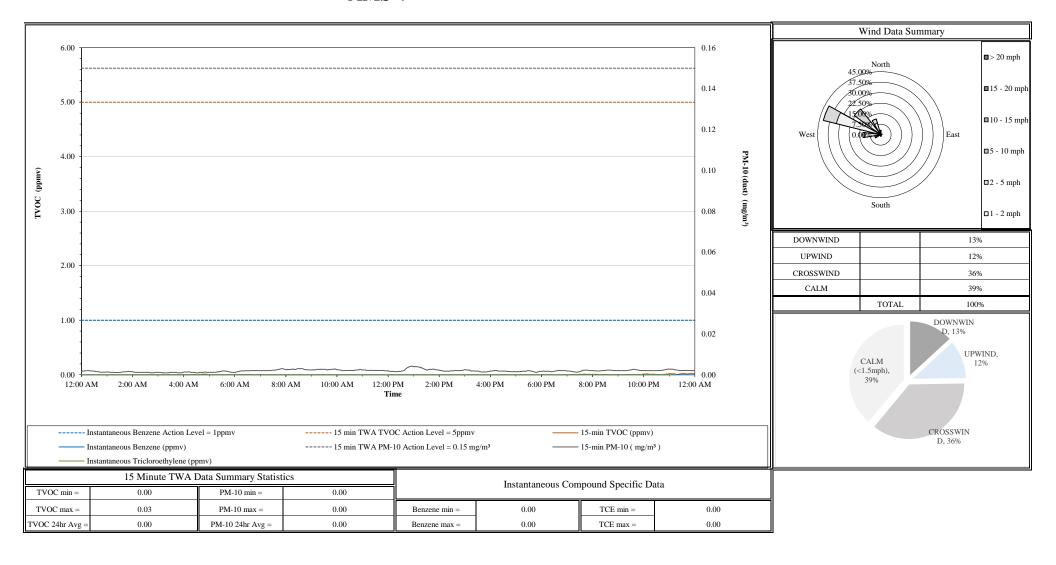

Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

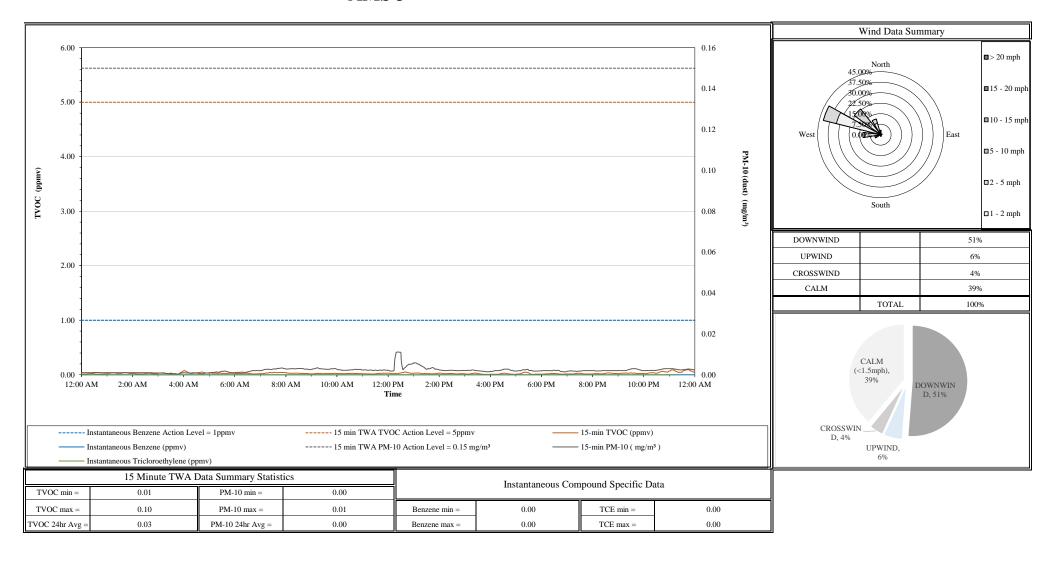



DATE: 10/09/24


FILE NO: 03.0034060.10

This Daily Air Monitoring Report summarizes perimeter air monitoring data collected during the referenced period in accordance with the Community Air Monitoring Plan (CAMP) which was included as part of the NYSDEC approved Remedial Action Work Plan for the Former Fulton Manufactured Gas Plant (MGP) Site – Parcel III and Portion of Parcel IV. Note: the information included in this daily summary is based on preliminary results and is subject to change based on data validation.

Reporting Period:	Wednesday, October 9, 2024					
Weather	Temperature: 56.70 – 71.60°F Preci	pitation: 0.00 in	Relative Humidity: 44.53%			
	Wind Speed: 0.22 – 5.73 mph	Prevailing Wind Direct	tion: WNW			
Concentrations detected	AMS-1: None	AMS-4: None				
above the Action Level	AMS-2: None	AMS-5: None				
	AMS-3: None	HH-1 (handheld readi	ngs along Degraw St): none			
Summary of Site	GZA continued CAMP monitoring 2	4 hours per day.				
Activities	CEI transported eight truckloads o	f non-hazardous soil to	Clean Earth of Southeast			
	Pennsylvania for treatment.					
	CEI continued removing the Parcel	V holder and operated	the VMS.			
	 CEI operated the water treatment 	system and American	Dewatering & Grouting			
	(ADG) operated the Parcel IV dewa	atering system.				
	CEI refueled equipment, received	a delivery and perform	ed general housekeeping.			
	 ENTACT continued mobilization of 	ISS equipment and ma	aterials and setting up the			
	Batch Plant.					
Community Inquiries	None					
Other	Charles Lambert (WSP) visited the Site.					
	 Mat Frankel (Langan) visited the Sit 	e.				

Figure 1 - CAMP Station Locations



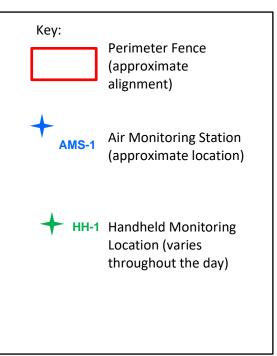

Daily Report No.: 786



DATE: 10/09/24 Daily Report No.: 786

FILE NO: 03.0034060.10

TABLE 1 – OFFSITE HANDHELD AIR MONITORING DATA

DATE	TIME	LOCATION	TVOC	PM ₁₀	NOTES
			ppm	mg/m³	
10/09/2024	8:30 AM	HH-1	0.0	0.026	-
10/09/2024	10:30 AM	HH-1	0.0	0.028	-
10/09/2024	12:30 PM	HH-1	0.0	0.036	-
10/09/2024	2:30 PM	HH-1	0.0	0.027	-

TABLE 2 – ODOR AND VISIBLE DUST MONITORING LOG

DATE	TIME	NUISANCE ODORS (YES/NO)	VISIBLE DUST (YES/NO)	NOTES
10/09/2024	8:30 AM	NO	NO	-
10/09/2024	10:30 AM	NO	NO	-
10/09/2024	12:30 PM	NO	NO	-
10/09/2024	2:30 PM	NO	NO	-


Attachments:

Daily Data Summary – Air Monitoring Stations 1 through 5


Prepared by: Geder Mena Reviewed by: Dan Amate

Construction Manager II Associate Principal

Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

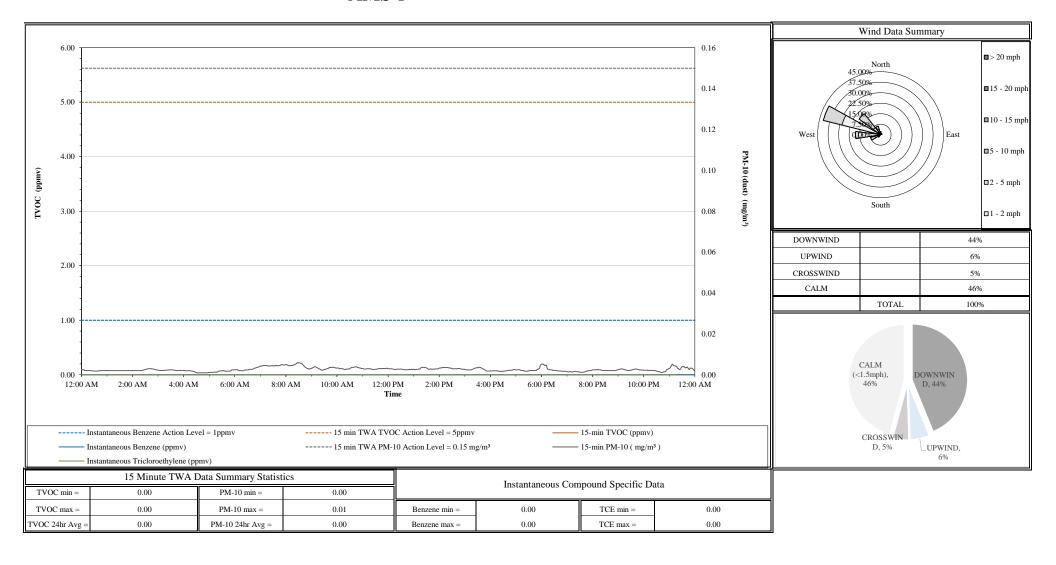


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

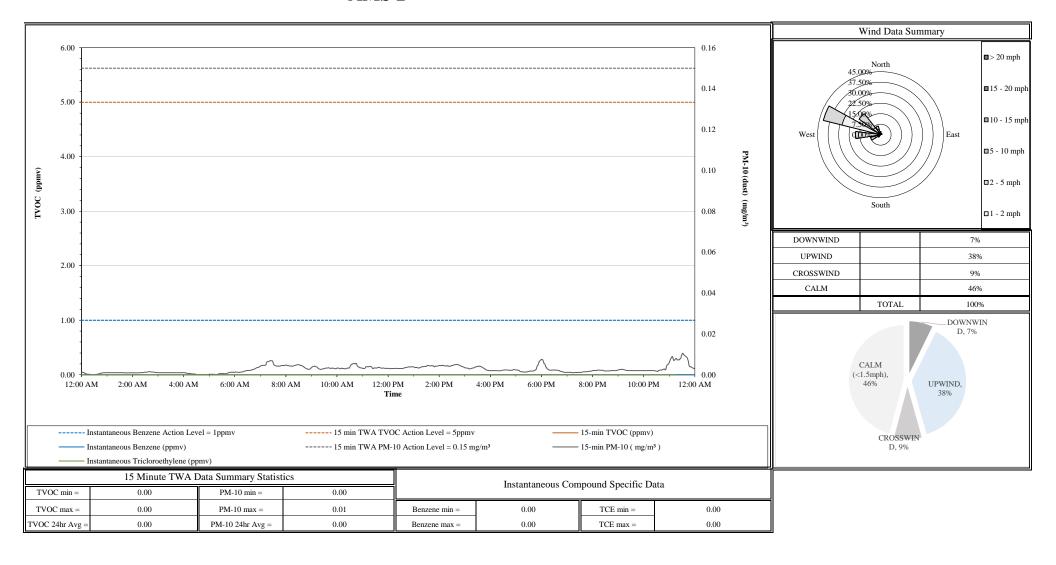


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

AMS 3

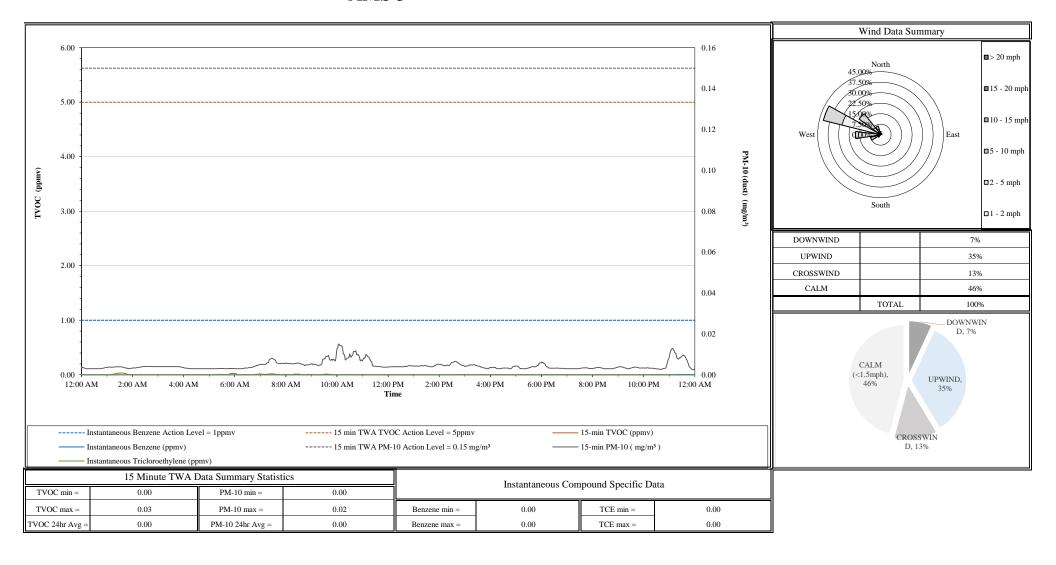


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

AMS 4

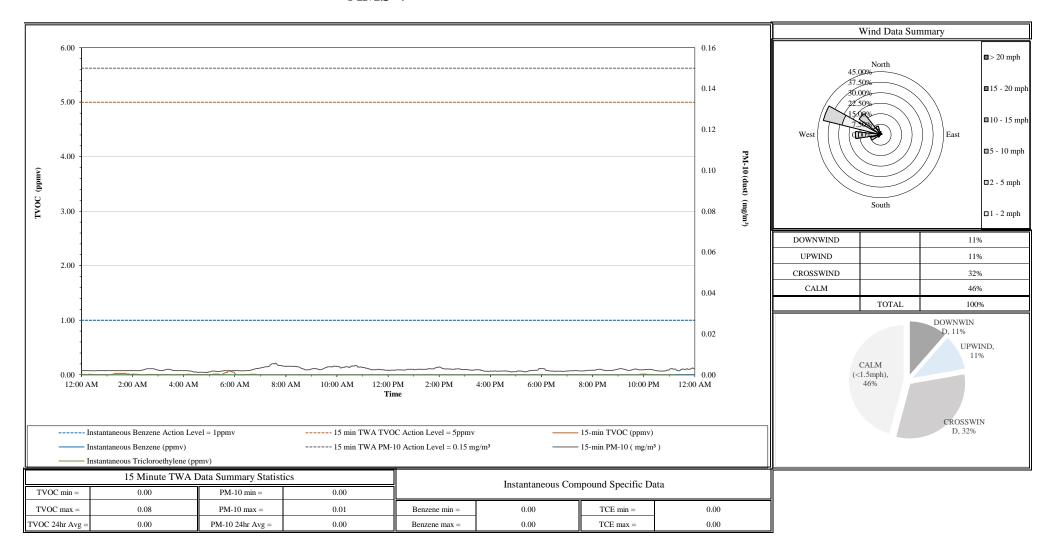

Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

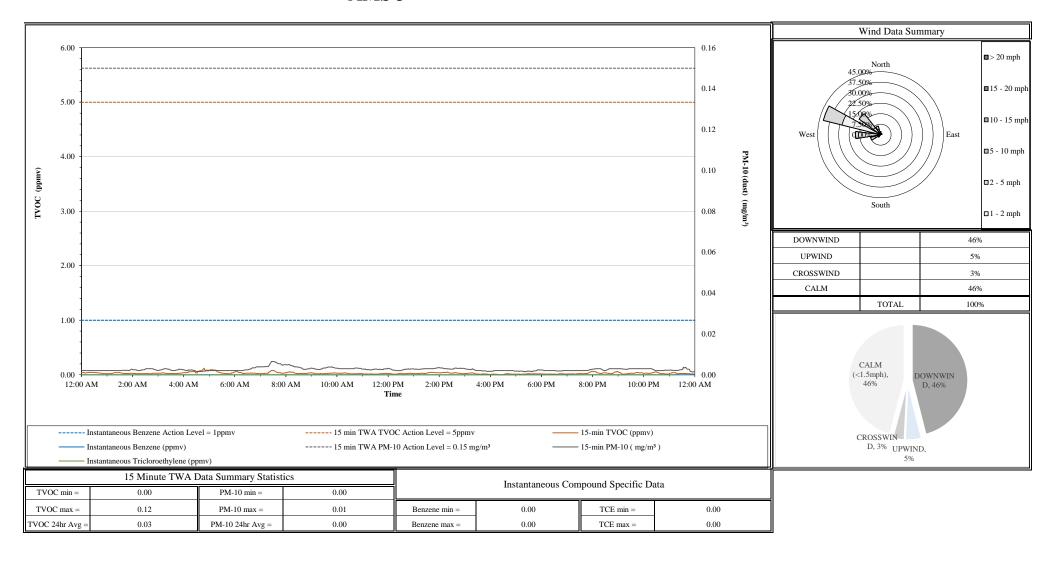



DATE: 10/10/24


FILE NO: 03.0034060.10

This Daily Air Monitoring Report summarizes perimeter air monitoring data collected during the referenced period in accordance with the Community Air Monitoring Plan (CAMP) which was included as part of the NYSDEC approved Remedial Action Work Plan for the Former Fulton Manufactured Gas Plant (MGP) Site - Parcel III and Portion of Parcel IV. Note: the information included in this daily summary is based on preliminary results and is subject to change based on data validation.

Reporting Period:	Thursday, October 10, 2024				
Weather	Temperature: 49.80 – 64.80°F F	recip	oitation: 0.00 in	Relative Humidity: 50.50%	
	Wind Speed: 0.63 – 7.09 mph		Prevailing Wind Direct	ion: NW	
Concentrations detected	AMS-1: None		AMS-4: None		
above the Action Level	AMS-2: None		AMS-5: None		
	AMS-3: None		HH-1 (handheld reading	ngs along Degraw St): none	
Summary of Site	GZA continued CAMP monitoria	g 24	hours per day.		
Activities	CEI imported 21 truckloads of	gene	ral fill and placed it in	the completed portion of	
	Parcel IV holder excavation.				
	 CEI continued removing the Par 	cel IV	/ holder and operated	the VMS.	
	 CEI operated the water treatm 	ent s	system and American	Dewatering & Grouting	
	(ADG) operated the Parcel IV o	ewat	tering system.		
	 CEI refueled equipment and po 	rforr	med general housekee	eping.	
	 ENTACT continued mobilizatio 	n of I	ISS equipment and ma	iterials.	
	Roux collected soil samples for the ISS Pilot Test and performed a SWPPP inspection.				
Community Inquiries	• None				
Other	Charles Lambert (WSP) visited the Site.				
	Mat Frankel (Langan) visited the	Site).		

Figure 1 - CAMP Station Locations



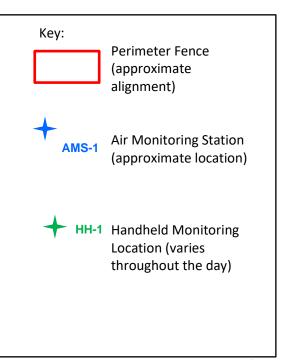

Daily Report No.: 787



DATE: 10/10/24 Daily Report No.: 787

FILE NO: 03.0034060.10

TABLE 1 – OFFSITE HANDHELD AIR MONITORING DATA

DATE	TIME	LOCATION	TVOC ppm	PM ₁₀ mg/m ³	NOTES
10/10/2024	8:30 AM	HH-1	0.0	0.020	-
10/10/2024	10:30 AM	HH-1	0.0	0.022	-
10/10/2024	12:30 PM	HH-1	0.0	0.033	-
10/10/2024	2:30 PM	HH-1	0.0	0.038	-

TABLE 2 – ODOR AND VISIBLE DUST MONITORING LOG

DATE	TIME	NUISANCE ODORS (YES/NO)	VISIBLE DUST (YES/NO)	NOTES
10/10/2024	8:30 AM	NO	NO	-
10/10/2024	10:30 AM	NO	NO	-
10/10/2024	12:30 PM	NO	NO	-
10/10/2024	2:30 PM	NO	NO	-


Attachments:

Daily Data Summary – Air Monitoring Stations 1 through 5


Prepared by: Geder Mena Reviewed by: Dan Amate

Construction Manager II Associate Principal


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

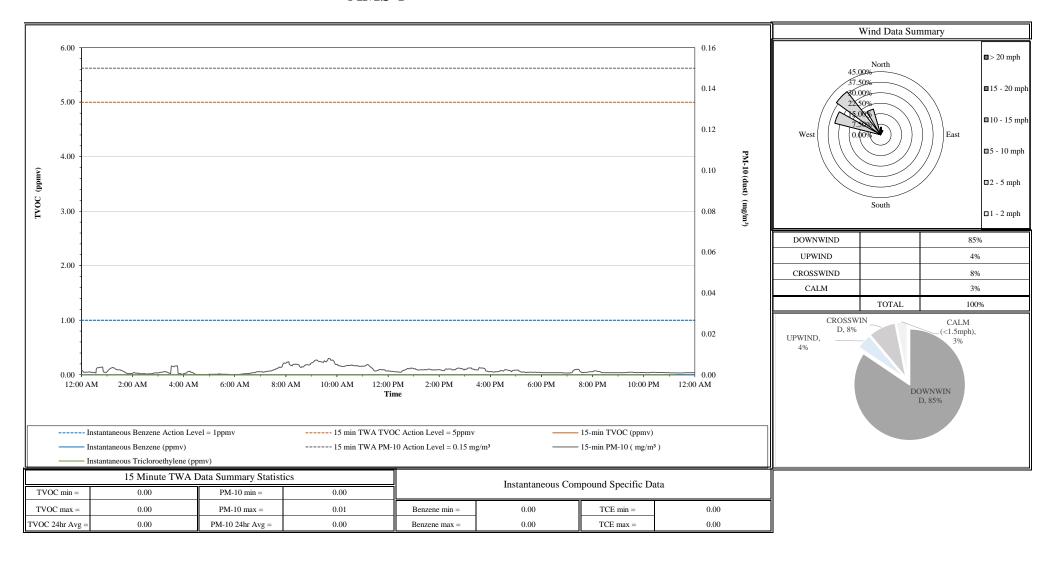

Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

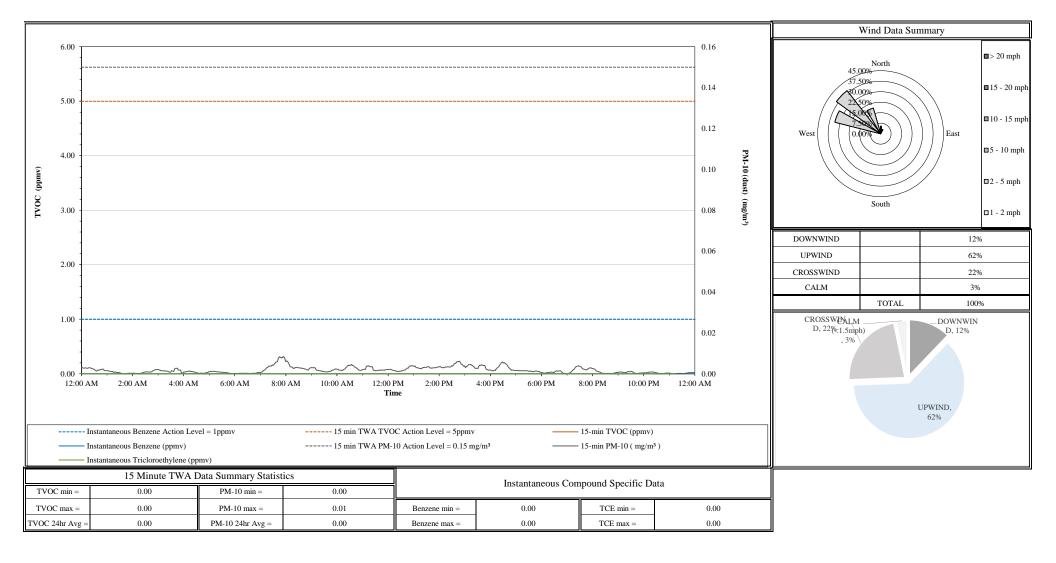


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

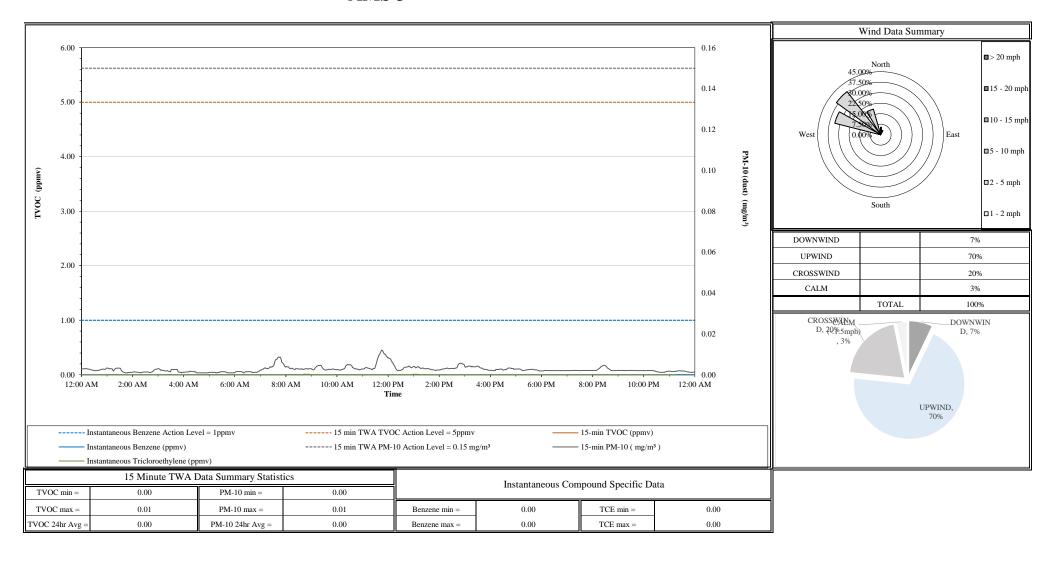


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

AMS 4

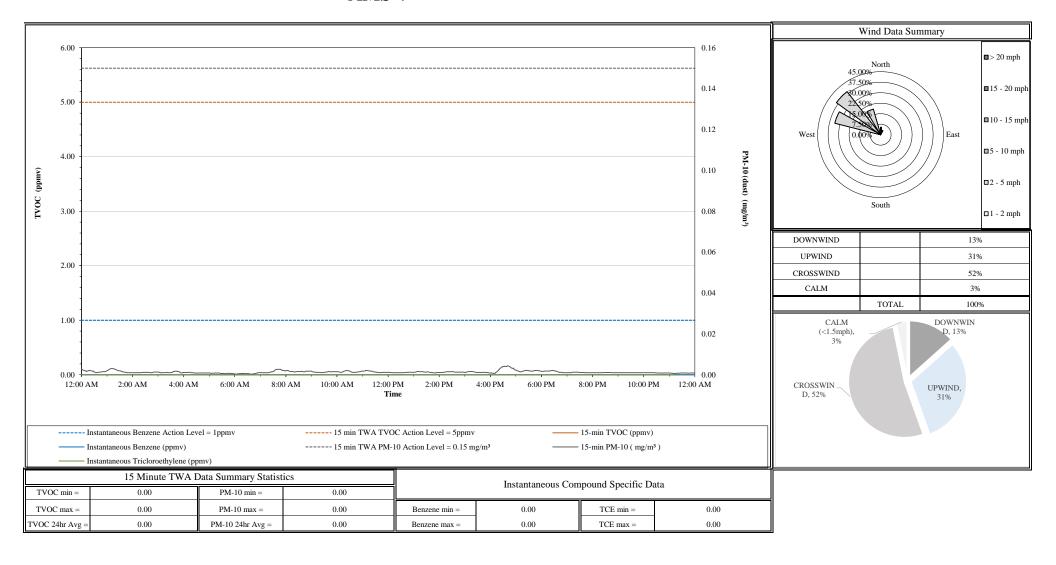

Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

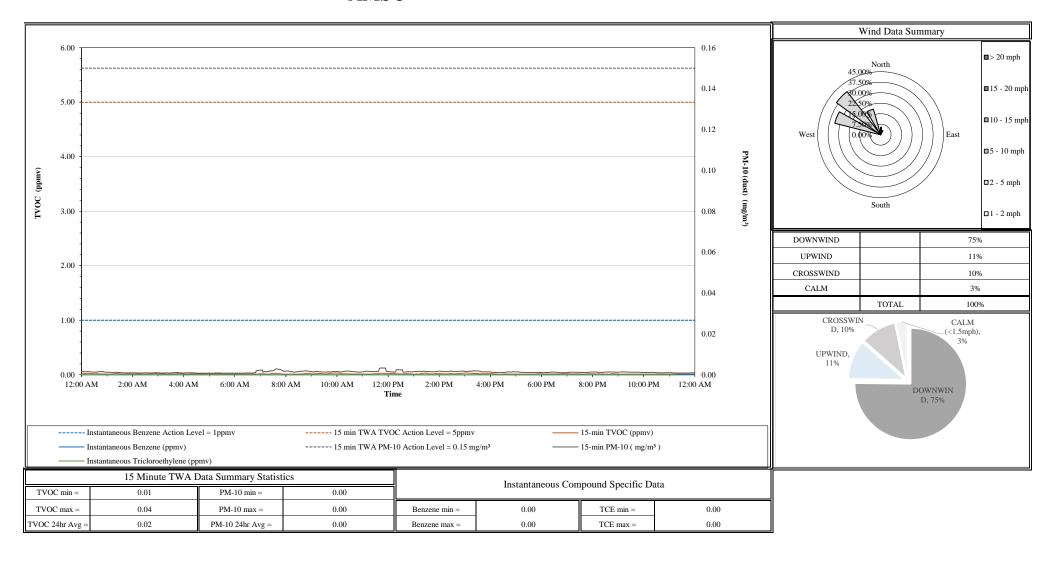



DATE: 10/11/24 Daily Report No.: 788

FILE NO: 03.0034060.10

This Daily Air Monitoring Report summarizes perimeter air monitoring data collected during the referenced period in accordance with the Community Air Monitoring Plan (CAMP) which was included as part of the NYSDEC approved Remedial Action Work Plan for the Former Fulton Manufactured Gas Plant (MGP) Site – Parcel III and Portion of Parcel IV. Note: the information included in this daily summary is based on preliminary results and is subject to change based on data validation.

	5 · 1					
Reporting Period:	Friday, October 11, 2024					
Weather	Temperature: 49.80 – 64.80°F	Preci	pitation: 0.00 in	Relative Humidity: 50.50%		
	Wind Speed: 0.63 – 7.09 mph		Prevailing Wind Direction: NW			
Concentrations detected	AMS-1: None		AMS-4: None			
above the Action Level	AMS-2: None		AMS-5: None			
	AMS-3: None		HH-1 (handheld readi	H-1 (handheld readings along Degraw St): none		
Summary of Site	GZA continued CAMP monitoring 24 hours per day.					
Activities	CEI imported 19 truckloads of general fill and placed it in the completed portion of					
	Parcel IV holder excavation.					
	CEI continued removing the Parcel IV holder and operated the VMS.					
	CEI operated the water treatment system and American Dewatering & Grouting					
	(ADG) operated the Parcel IV dewatering system. CEI removed the cover over the					
	WTS vessels in preparation to perform a media changeout.					
	CEI refueled equipment, performed general housekeeping, refreshed utility mark					
	outs and secured the Site for the weekend.					
	ENTACT continued mobilization of ISS equipment and materials.					
Community Inquiries	• None					
Other	Charles Lambert (WSP) visited the Site.					
	Mat Frankel (Langan) visited the Site.					

Figure 1 - CAMP Station Locations





DATE: 10/11/24 Daily Report No.: 788

FILE NO: 03.0034060.10

TABLE 1 – OFFSITE HANDHELD AIR MONITORING DATA

DATE	TIME	LOCATION	TVOC	PM ₁₀	NOTES
			ppm	mg/m³	
10/11/2024	8:30 AM	HH-1	0.0	0.011	-
10/11/2024	10:30 AM	HH-1	0.0	0.009	-
10/11/2024	12:30 PM	HH-1	0.0	0.015	-
10/1/2024	2:30 PM	HH-1	0.0	0.013	-

TABLE 2 – ODOR AND VISIBLE DUST MONITORING LOG

DATE	TIME	NUISANCE ODORS (YES/NO)	VISIBLE DUST (YES/NO)	NOTES
10/11/2024	8:30 AM	NO	NO	-
10/11/2024	10:30 AM	NO	NO	-
10/11/2024	12:30 PM	NO	NO	-
10/11/2024	2:30 PM	NO	NO	-


Attachments:

Daily Data Summary – Air Monitoring Stations 1 through 5


Prepared by: Geder Mena Reviewed by: Dan Amate

Construction Manager II Associate Principal


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

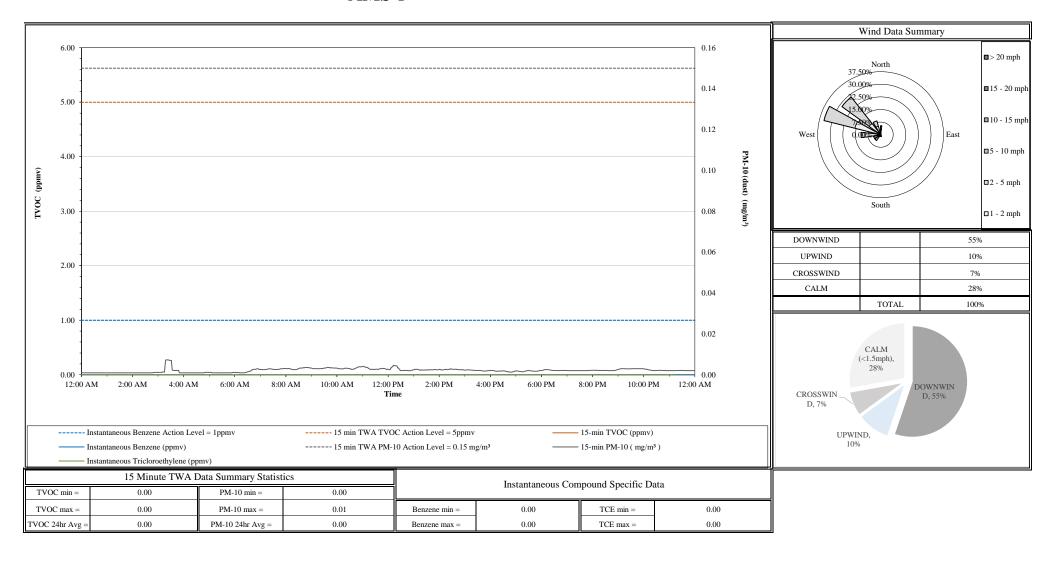


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

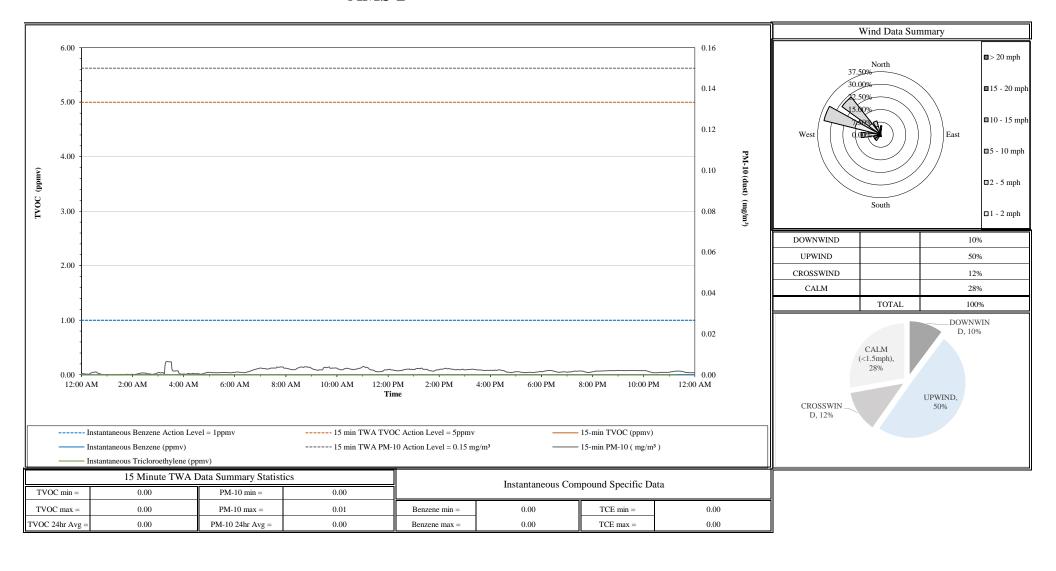


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

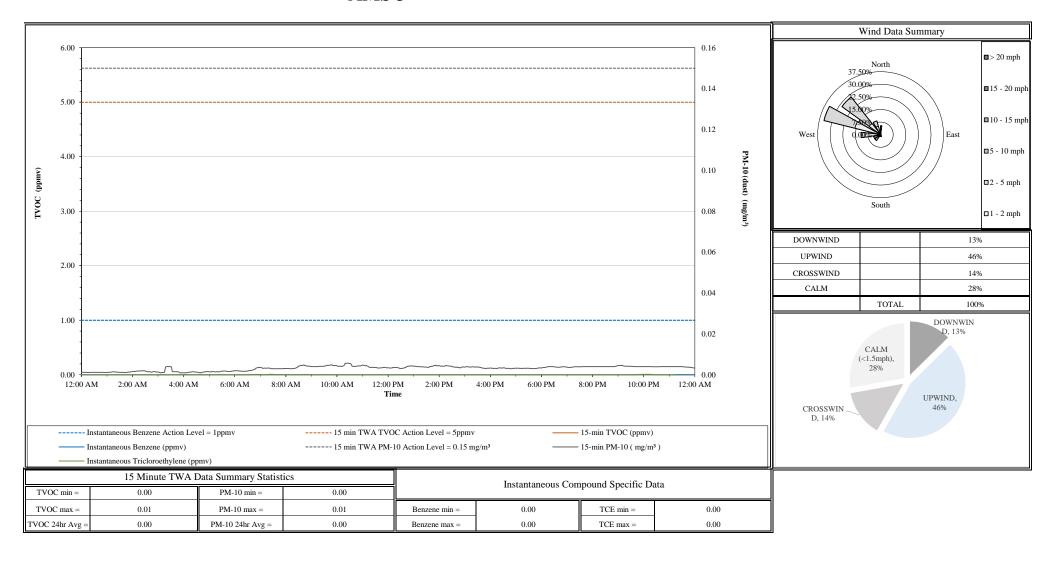

AMS 4

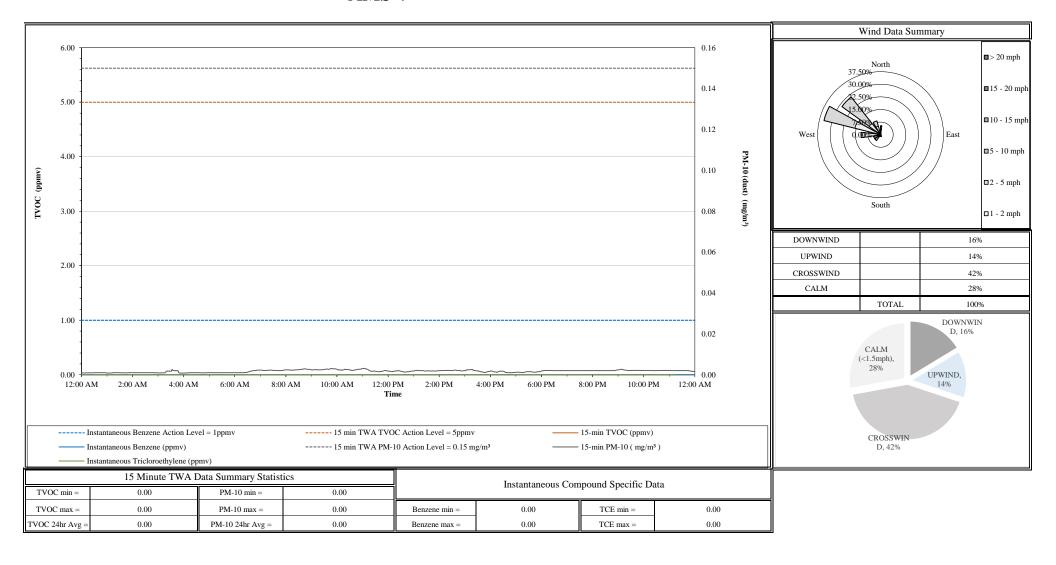

Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

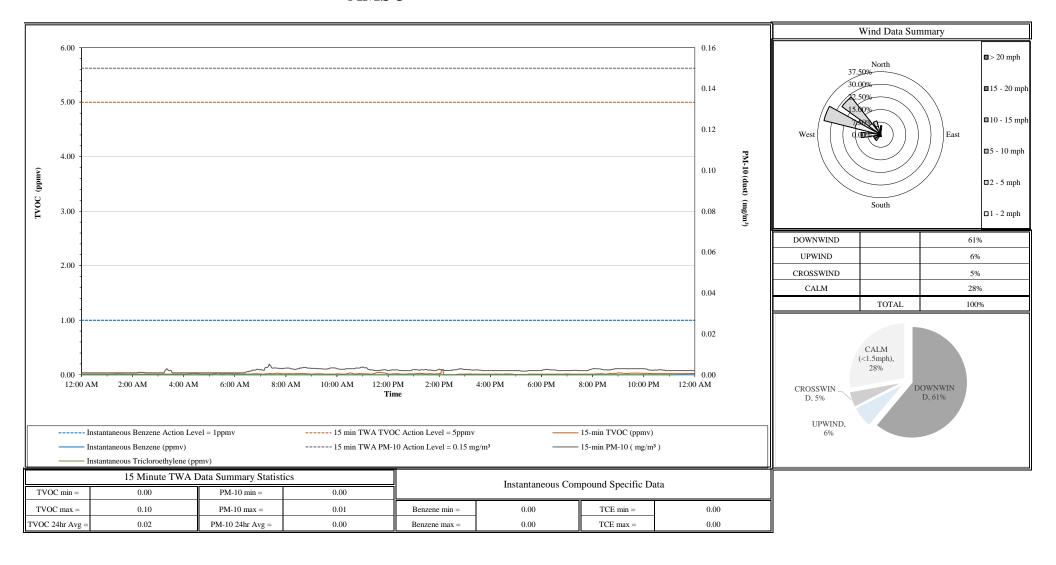



DATE: 10/12/24

FILE NO: 03.0034060.10

This Daily Air Monitoring Report summarizes perimeter air monitoring data collected during the referenced period in accordance with the Community Air Monitoring Plan (CAMP) which was included as part of the NYSDEC approved Remedial Action Work Plan for the Former Fulton Manufactured Gas Plant (MGP) Site – Parcel III and Portion of Parcel IV. Note: the information included in this daily summary is based on preliminary results and is subject to change based on data validation.

Reporting Period:	Saturday, October 12, 2024				
Weather	Temperature: 58.30 – 76.60°F Preci		pitation: 0.00 in	Relative Humidity: 40.65%	
	Wind Speed: 0.22 – 6.07 mph		Prevailing Wind Direct	tion: NW	
Concentrations detected	AMS-1: None		AMS-4: None		
above the Action Level	AMS-2: None		AMS-5: None		
	AMS-3: None		HH-1 (handheld readings along Degraw St): none		
Summary of Site	GZA continued CAMP monitoring 24 hours per day.				
Activities	CEI operated the water treatment system and American Dewatering & Grouting				
	(ADG) operated the Parcel IV dewatering system.				
Community Inquiries	None				
Other	None				

Figure 1 – CAMP Station Locations



Daily Report No.: 789



DATE: 10/12/24 Daily Report No.: 789

FILE NO: 03.0034060.10

TABLE 1 – OFFSITE HANDHELD AIR MONITORING DATA

DATE	TIME	LOCATION	TVOC ppm	PM ₁₀ mg/m ³	NOTES
-	-	-	-	-	CAMP monitored remotely (weekend)
-	-	-	-	-	CAMP monitored remotely (weekend)
-	-	-	-	-	CAMP monitored remotely (weekend)
-	-	-	-	-	CAMP monitored remotely (weekend)

TABLE 2 – ODOR AND VISIBLE DUST MONITORING LOG

DATE	TIME	NUISANCE ODORS (YES/NO)	VISIBLE DUST (YES/NO)	NOTES
-	-	-	-	CAMP monitored remotely (weekend)
-	-	-	-	CAMP monitored remotely (weekend)
-	-	-	-	CAMP monitored remotely (weekend)
-	-	-	-	CAMP monitored remotely (weekend)


Attachments:

Daily Data Summary – Air Monitoring Stations 1 through 5


Prepared by: Geder Mena Reviewed by: Dan Amate

Construction Manager II Associate Principal


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

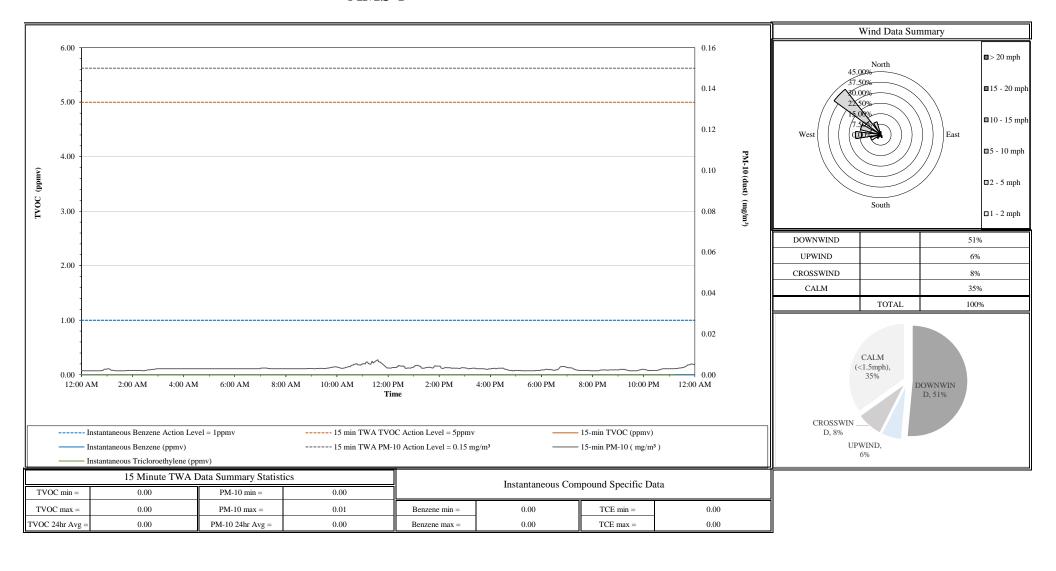


AMS 2

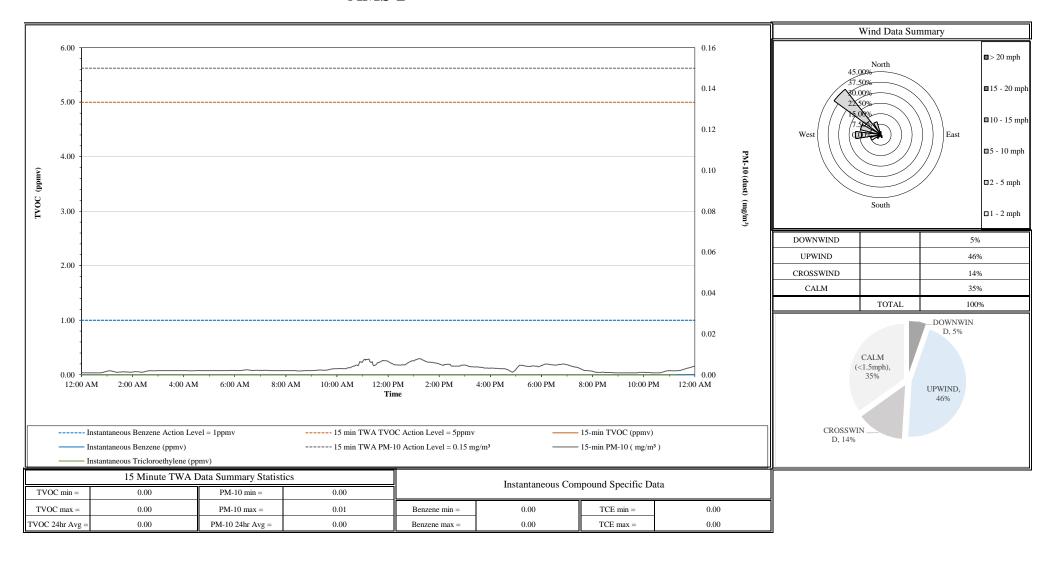


AMS 3

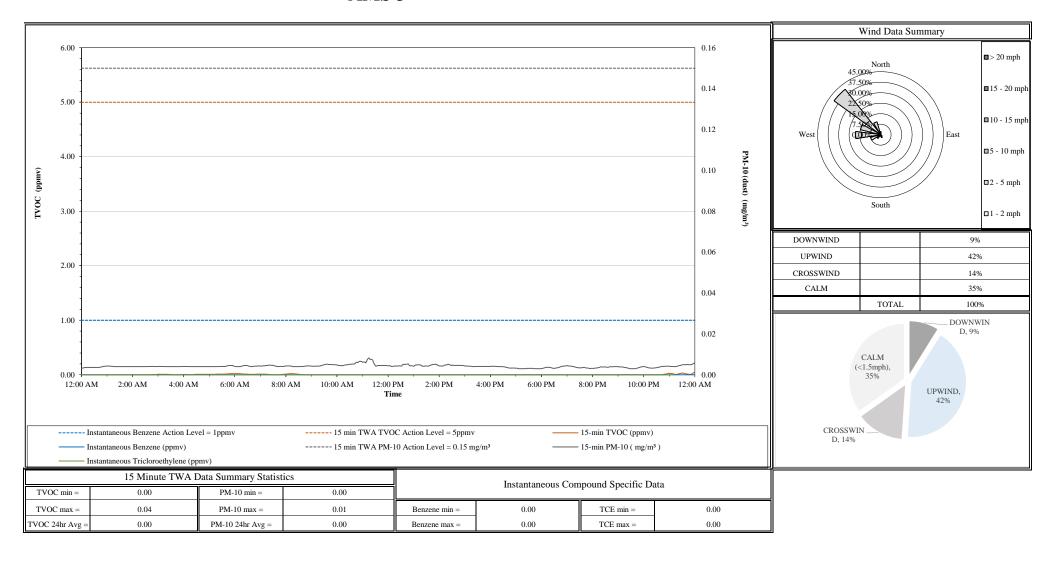

Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

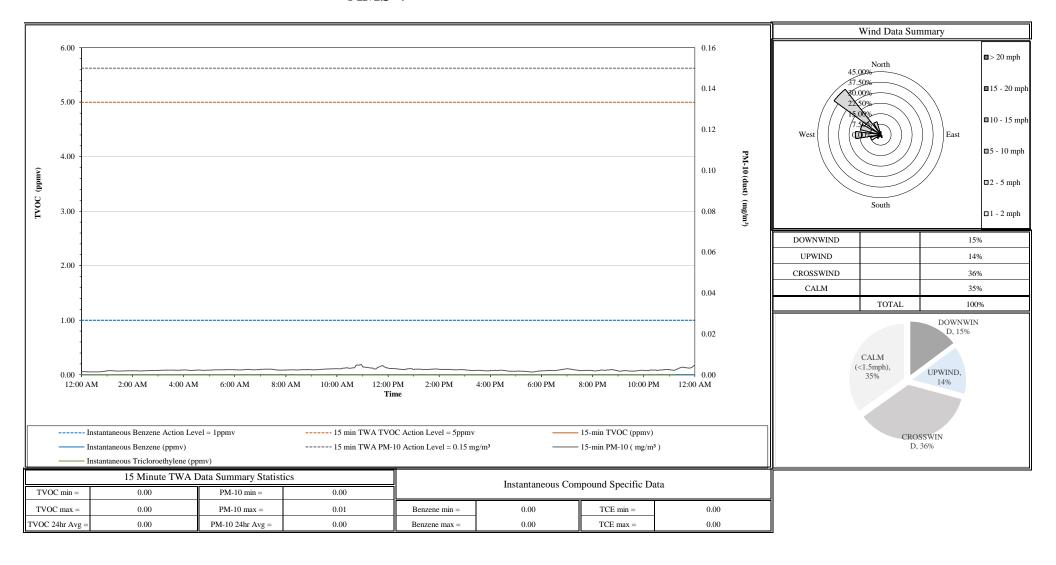

Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

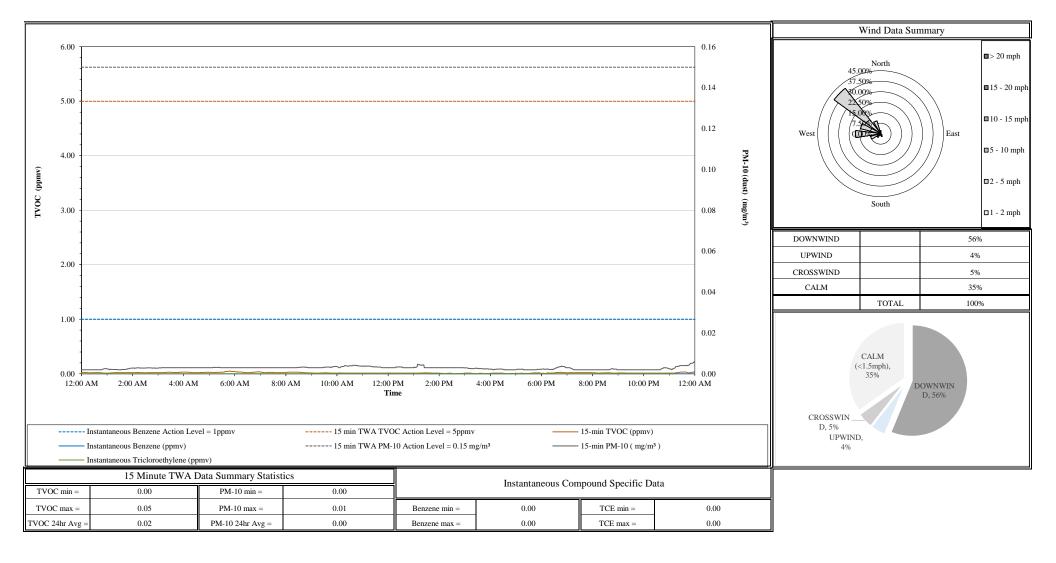



DATE: 10/13/24

FILE NO: 03.0034060.10

This Daily Air Monitoring Report summarizes perimeter air monitoring data collected during the referenced period in accordance with the Community Air Monitoring Plan (CAMP) which was included as part of the NYSDEC approved Remedial Action Work Plan for the Former Fulton Manufactured Gas Plant (MGP) Site – Parcel III and Portion of Parcel IV. Note: the information included in this daily summary is based on preliminary results and is subject to change based on data validation.

Reporting Period:	Sunday October 13, 2024				
Weather	Temperature: 56.70 – 74.10°F	Preci	pitation: 0.00 in	Relative Humidity: 55.81%	
	Wind Speed: 0.12 – 4.59 mph		Prevailing Wind Direc	tion: NE	
Concentrations detected	AMS-1: None		AMS-4: None		
above the Action Level	AMS-2: None		AMS-5: None		
	AMS-3: None		HH-1 (handheld readings along Degraw St): none		
Summary of Site	GZA continued CAMP monitoring 24 hours per day.				
Activities	CEI operated the water treatment system and American Dewatering & Grouting				
	(ADG) operated the Parcel IV dewatering system.				
Community Inquiries	None				
Other	None				

Figure 1 - CAMP Station Locations



Daily Report No.: 790



DATE: 10/13/24 Daily Report No.: 790

FILE NO: 03.0034060.10

TABLE 1 – OFFSITE HANDHELD AIR MONITORING DATA

DATE	TIME	LOCATION	TVOC ppm	PM ₁₀ mg/m ³	NOTES
-	-	-	-	-	CAMP monitored remotely (weekend)
-	-	-	-	-	CAMP monitored remotely (weekend)
-	-	-	-	-	CAMP monitored remotely (weekend)
-	-	-	-	-	CAMP monitored remotely (weekend)

TABLE 2 – ODOR AND VISIBLE DUST MONITORING LOG

DATE	TIME	NUISANCE ODORS (YES/NO)	VISIBLE DUST (YES/NO)	NOTES
-	-	-	-	CAMP monitored remotely (weekend)
-	-	-	-	CAMP monitored remotely (weekend)
-	-	-	-	CAMP monitored remotely (weekend)
-	-	-	-	CAMP monitored remotely (weekend)


Attachments:

Daily Data Summary – Air Monitoring Stations 1 through 5


Prepared by: Geder Mena Reviewed by: Dan Amate

Construction Manager II Associate Principal


Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

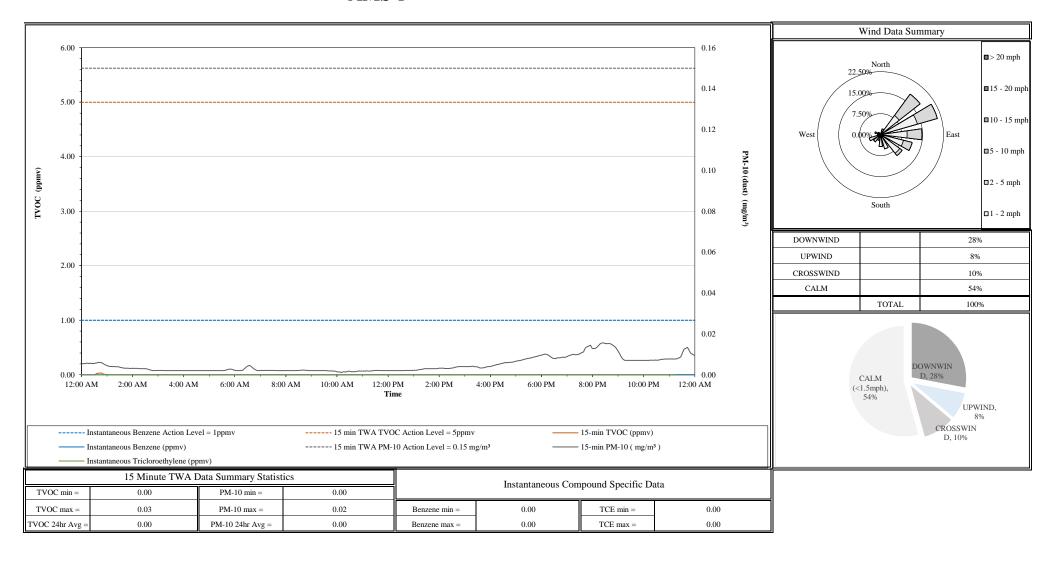


AMS 2

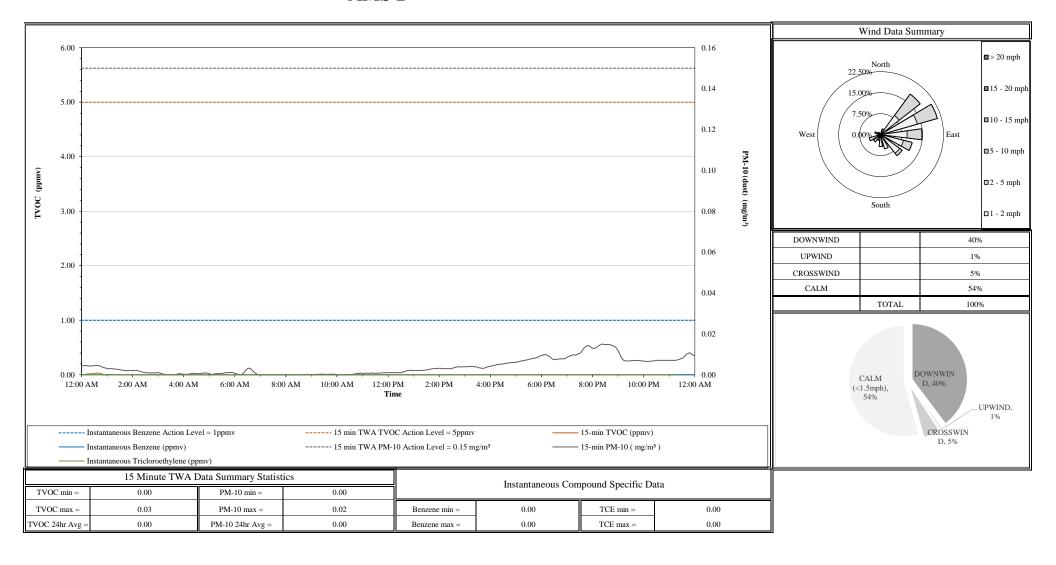

AMS 3

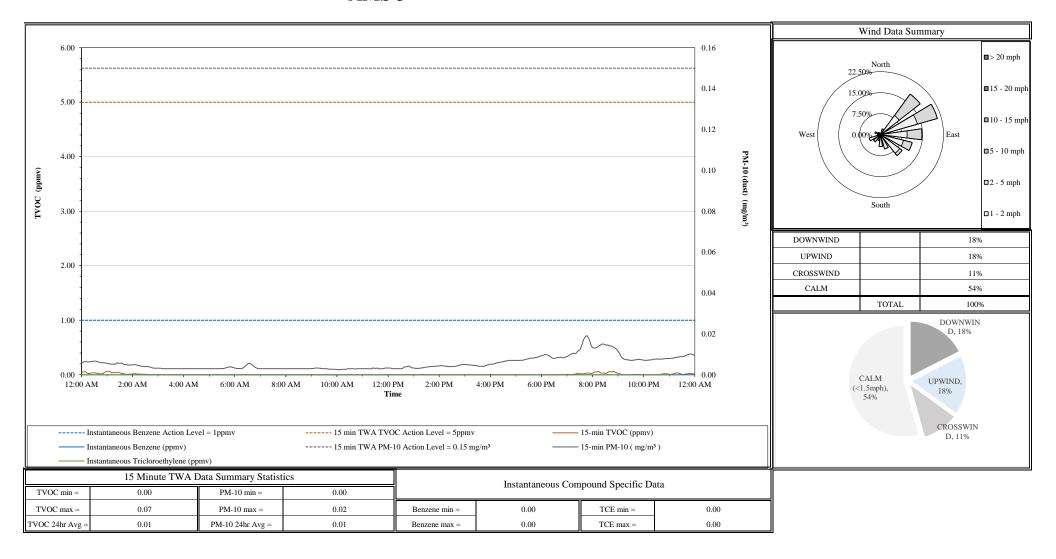

Former Fulton MGP Site Parcel III and Portion of Parcel IV Brooklyn, NY

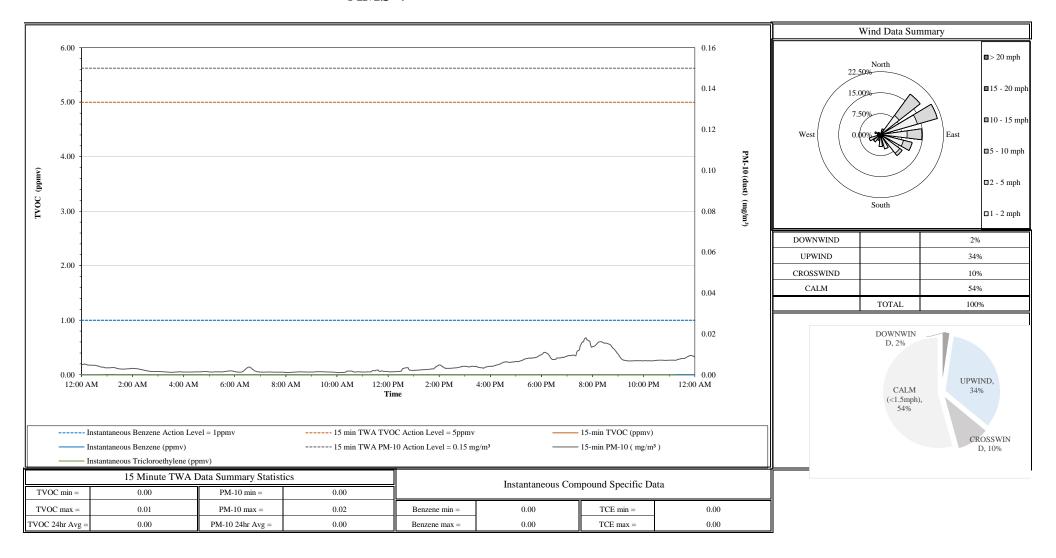

AMS 5

