

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	150
NYSDEC Site	NYSDEC Site 224136	Date	3/9/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	35-48°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering,	Wind Direction	From NW to SE up to 12 mph
Weather	Sunny	Personnel on Site	S. Sotomayor
Humidity	45%	Time on Site	7:00am to 6:00pm

Haley & Aldrich of New York (Haley & Aldrich) was present to document the installation of the off-site (OU-2) LNAPL barrier wall. Site Observations are summarized below.

Daily Observations:

- Contractor demobilizing equipment from OU-2 work area. OU-2 LNAPL barrier wall complete, no intrusive work conducted.
- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 13.72 ft and water detected at 13.74 ft. Approximately 0.80 gallons of LNAPL recovered to date.
- Contractor demobilized equipment and secured OU-1 and OU-2 work area. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	<i>Clean Earth of Carteret, NJ</i>															<i>Totals:</i>
<i>Today:</i>	1 load	12 tons														
<i>Total:</i>	<u>10</u> loads	<u>120</u> tons														

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at one upwind and two downwind locations on-site from 7:30am to 5:30 pm. No intrusive work conducted in OU-2. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.

Activities Planned for Coming Week:

- Demobilize and restore sidewalk in OU-2 work area.
- Install monitoring wells near OU-2 LNAPL barrier wall.
- Continue installation of sheet pile walls in OU-1.


Site Photographs:

Photo 1: View of the site facing north.



Photo 2: View of OU-2 work area facing northwest.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Map\2022_12_Former_Nuhart_East\0201891_000_0002_SITE_PLAN.mxd - hwaachob - 1/25/2023 1:10:37 PM

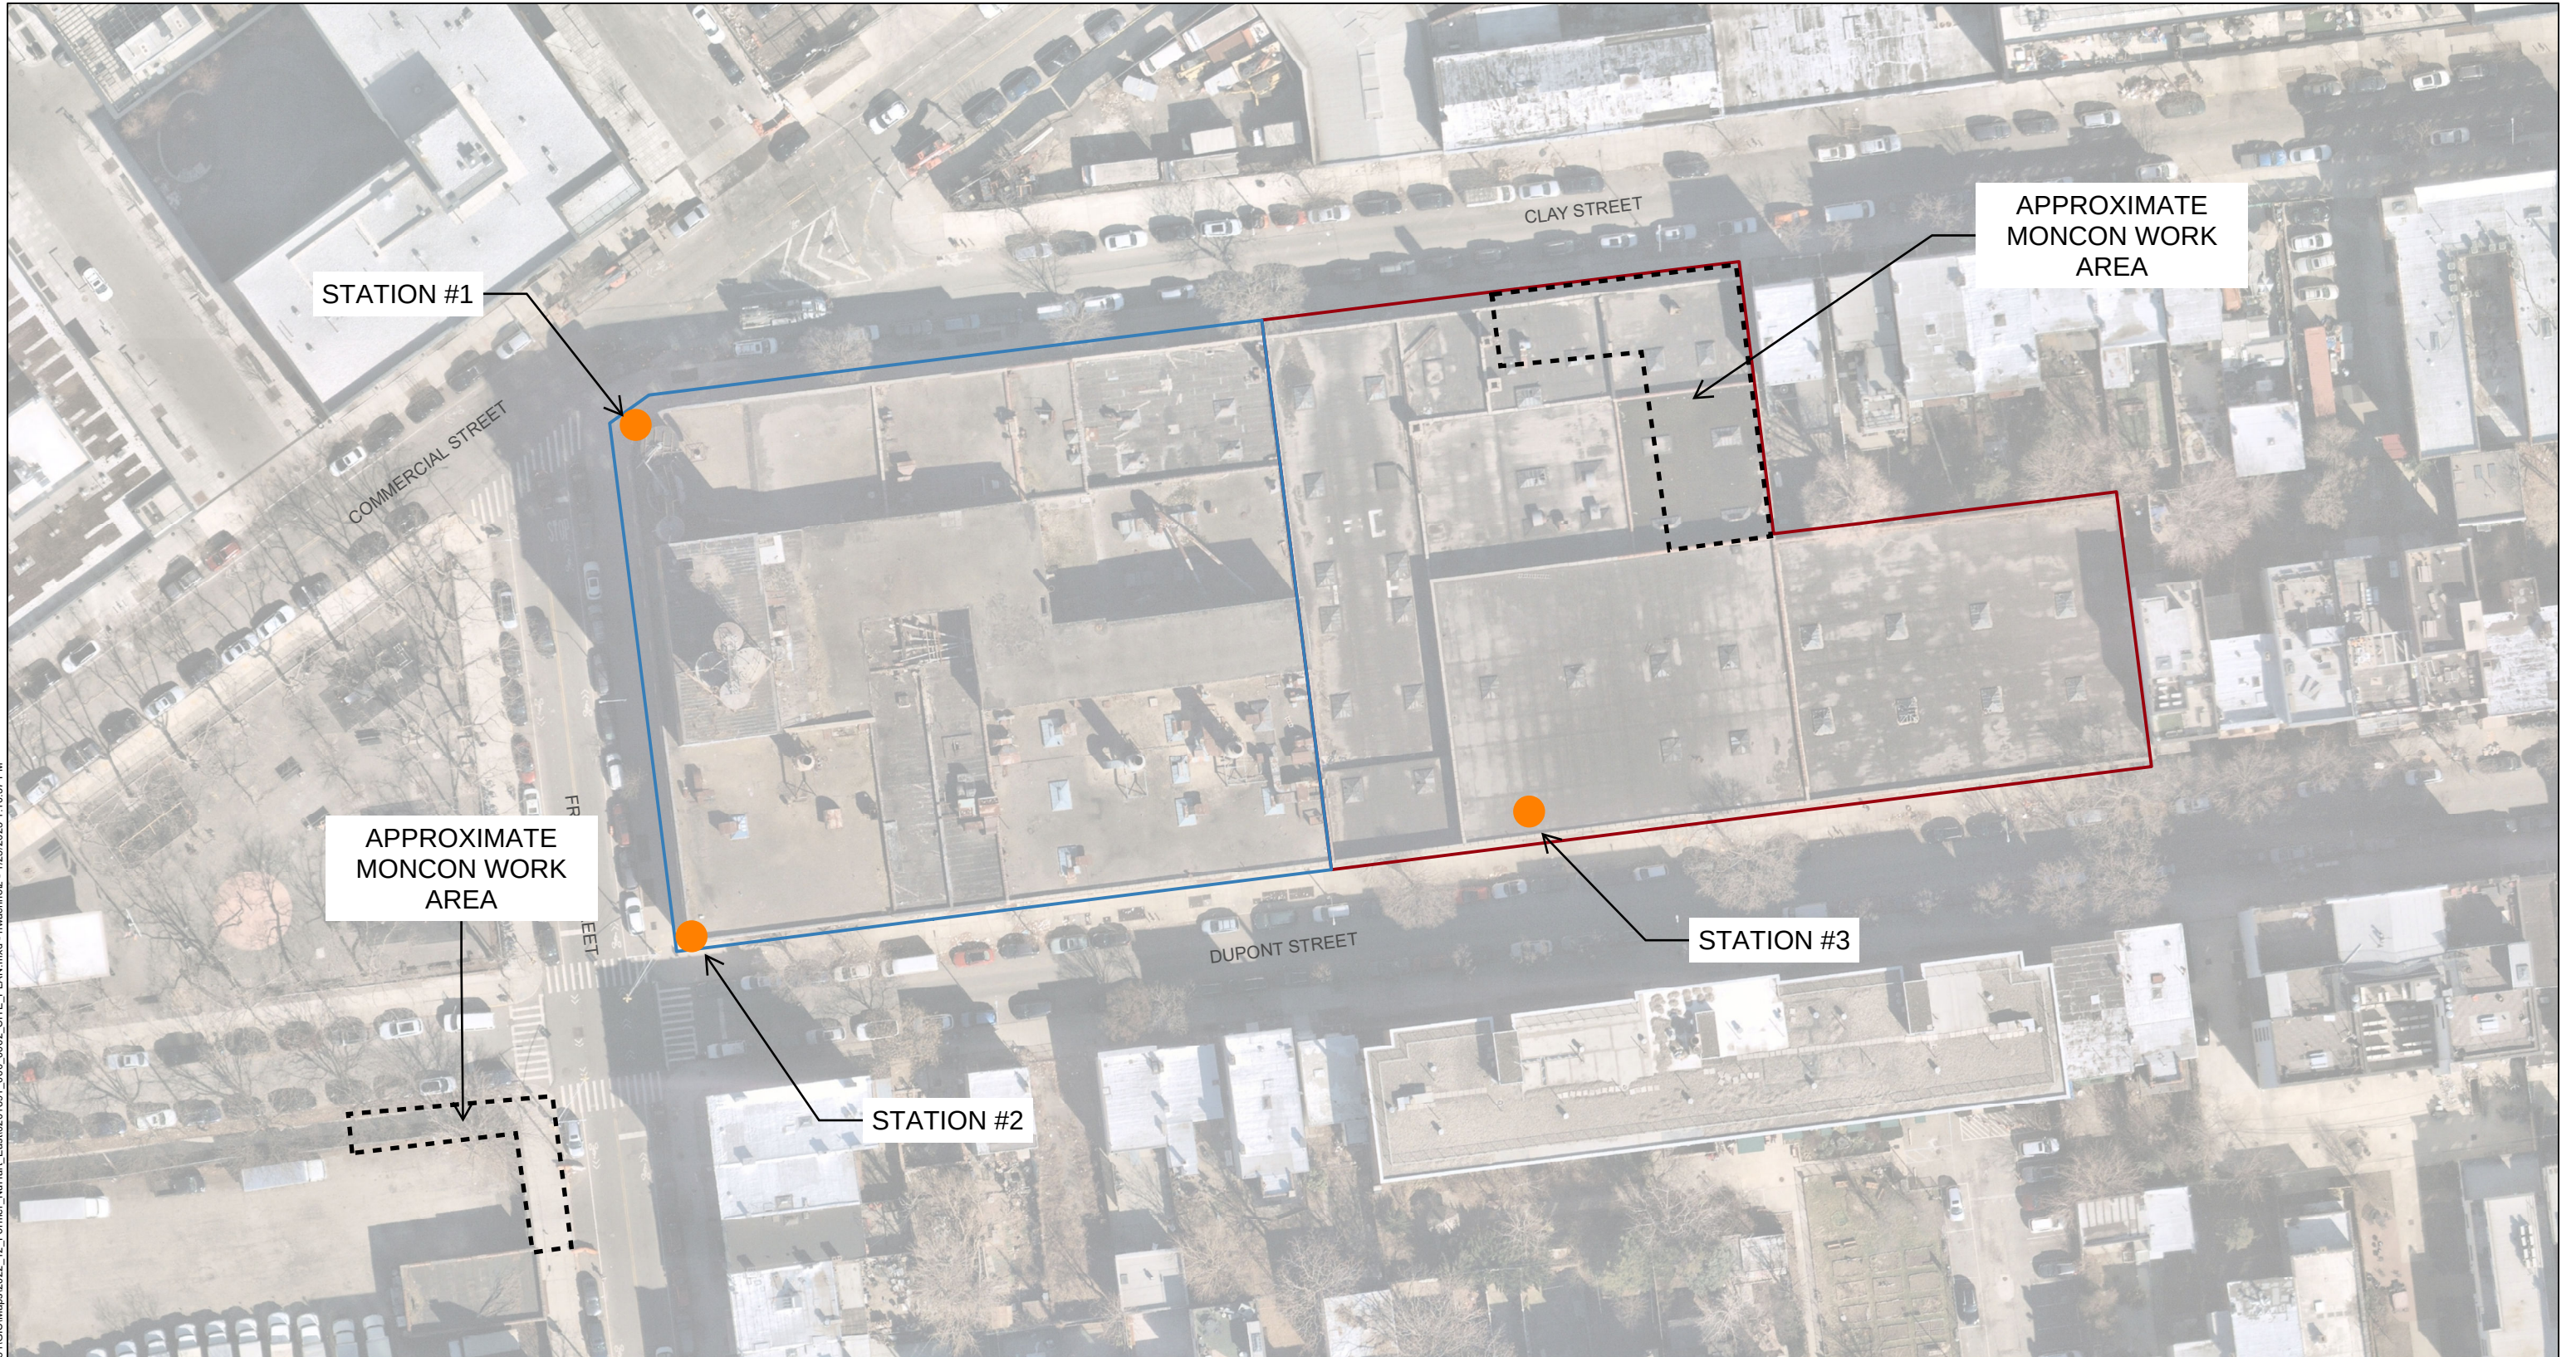

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

FEBRUARY 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log
On-Site (OU-1) Work Activities

Date : 2023-03-09

Personnel : S. Sotomayor
Weather : 35-48°F, Sunny
Humidity : 45%
Wind Direction : NW to SE

Particulate Background (mg/m³) : 0.007
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. VOC (Station1)	Avg. VOC (Station2)	Avg. VOC (Station3)	Odors	Notes Activities/ Additional Monit..
07:15			0.007			0.0		
07:30	0.010	0.015	0.006	0.0	0.0	0.0		
07:45	0.009	0.008	0.006	0.0	0.0	0.0		
08:00	0.008	0.008	0.006	0.0	0.0	0.0		
08:15	0.008	0.008	0.005	0.0	0.0	0.0		
08:30	0.008	0.009	0.005	0.0	0.0	0.0		
08:45	0.007	0.008	0.005	0.0	0.0	0.0		
09:00	0.006	0.007	0.004	0.0	0.0	0.0		
09:15	0.007	0.008	0.004	0.0	0.0	0.0		
09:30	0.006	0.008	0.004	0.0	0.0	0.0		
09:45	0.006	0.009	0.005	0.0	0.0	0.0		
10:00	0.005	0.008	0.005	0.0	0.0	0.0		
10:15	0.005	0.008	0.006	0.0	0.0	0.0		
10:30	0.006	0.008	0.004	0.0	0.0	0.0		
10:45	0.006	0.008	0.005	0.0	0.0	0.0		
11:00	0.006	0.008	0.005	0.0	0.0	0.0		
11:15	0.006	0.008	0.005	0.0	0.0	0.0		
11:30	0.006	0.008	0.005	0.0	0.0	0.0		
11:45	0.005	0.008	0.005	0.0	0.0	0.0		
12:00	0.006	0.008	0.005	0.0	0.0	0.0		
12:15	0.005	0.008	0.005	0.0	0.0	0.0		
12:30	0.005	0.008	0.004	0.0	0.0	0.0		
12:45	0.006	0.008	0.005	0.0	0.0	0.0		
13:00	0.006	0.008	0.005	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. VOC (Station1)	Avg. VOC (Station2)	Avg. VOC (Station3)	Odors	Notes Activities/ Additional Monitoring
13:15	0.006	0.008	0.006	0.0	0.0	0.0		
13:30	0.006	0.007	0.005	0.0	0.0	0.0		
13:45	0.006	0.007	0.005	0.0	0.0	0.0		
14:00	0.006	0.008	0.005	0.0	0.0	0.0		
14:15	0.007	0.008	0.006	0.0	0.0	0.0		
14:30	0.006	0.007	0.005	0.0	0.0	0.0		
14:45	0.006	0.007	0.005	0.0	0.0	0.0		
15:00	0.006	0.007	0.004	0.0	0.0	0.0		
15:15	0.006	0.007	0.004	0.0	0.0	0.0		
15:30	0.006	0.007	0.004	0.0	0.0	0.0		
15:45	0.006	0.007	0.005	0.0	0.0	0.0		
16:00	0.006	0.007	0.008	0.0	0.0	0.0		
16:15	0.006	0.007	0.007	0.0	0.0	0.0		
16:30	0.006	0.008	0.007	0.0	0.0	0.0		
16:45	0.006	0.007	0.007	0.0	0.0	0.0		
17:00	0.007	0.007	0.007	0.0	0.0	0.0		
17:15	0.006	0.008	0.007	0.0	0.0	0.0		
17:30	0.006	0.008	0.008	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	151
NYSDEC Site	NYSDEC Site 224136	Date	3/10/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	38-45°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering,	Wind Direction	From NW to SE up to 5 mph
Weather	Overcast	Personnel on Site	S. Sotomayor
Humidity	35%	Time on Site	7:00am to 6:00pm

Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street and view demobilization from OU-2. Site Observations are summarized below.

Daily Observations:

- Contractor demobilizing equipment from OU-2 work area. OU-2 LNAPL barrier wall complete, no intrusive work conducted.
- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 13.71 ft and water detected at 13.73 ft. Approximately 0.80 gallons of LNAPL recovered to date.
- Contractor demobilized equipment and secured OU-1 and OU-2 work areas. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ													Totals:
Today:	0 load	0 tons												
Total:	<u>10</u> loads	<u>120</u> tons												

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at one upwind and two downwind locations on-site from 7:30am to 5:15 pm. No intrusive work conducted in OU-2. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.

Activities Planned for Coming Week:

- Demobilize and restore sidewalk in OU-2 work area.
- Install monitoring wells near OU-2 LNAPL barrier wall.
- Continue installation of sheet pile walls in OU-1.

Site Photographs:

Photo 1: View of the site facing north.



Photo 2: View of OU-2 work area facing northwest.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\0201891_000_0002_SITE_PLAN.mxd - hwalcholz - 1/25/2023 1:10:37 PM



LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log
On-Site (OU-1) Work Activities

Date : 2023-03-10

Personnel : S. Sotomayor
Weather : 38-45°F, Overcast
Humidity : 35%
Wind Direction : NW to SE

Particulate Background (mg/m³) : 0.011
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. VOC (Station1)	Avg. VOC (Station2)	Avg. VOC (Station3)	Odors	Notes Activities/ Additional Monit..
07:30	0.013	0.011	0.011	0.0	0.0	0.0		
07:45	0.012	0.010	0.009	0.0	0.0	0.0		
08:00	0.011	0.009	0.009	0.0	0.0	0.0		
08:15	0.011	0.010	0.009	0.0	0.0	0.0		
08:30	0.011	0.009	0.007	0.0	0.0	0.0		
08:45	0.010	0.009	0.007	0.0	0.0	0.0		
09:00	0.010	0.009	0.007	0.0	0.0	0.0		
09:15	0.010	0.010	0.008	0.0	0.0	0.0		
09:30	0.012	0.011	0.008	0.0	0.0	0.0		
09:45	0.012	0.010	0.007	0.0	0.0	0.0		
10:00	0.013	0.011	0.007	0.0	0.0	0.0		
10:15	0.011	0.011	0.010	0.0	0.0	0.0		
10:30	0.010	0.010	0.008	0.0	0.0	0.0		
10:45	0.009	0.010	0.008	0.0	0.0	0.0		
11:00	0.010	0.010	0.010	0.0	0.0	0.0		
11:15	0.011	0.011	0.012	0.0	0.0	0.0		
11:30	0.010	0.010	0.010	0.0	0.0	0.0		
11:45	0.011	0.010	0.009	0.0	0.0	0.0		
12:00	0.012	0.013	0.010	0.0	0.0	0.0		
12:15	0.012	0.012	0.011	0.0	0.0	0.0		
12:30	0.011	0.010	0.009	0.0	0.0	0.0		
12:45	0.013	0.013	0.020	0.0	0.0	0.0		
13:00	0.012	0.010	0.035	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. VOC (Station1)	Avg. VOC (Station2)	Avg. VOC (Station3)	Odors	Notes Activities/ Additional Monitoring
13:15	0.013	0.011	0.010	0.0	0.0	0.0		
13:30	0.012	0.011	0.011	0.0	0.0	0.0		
13:45	0.012	0.012	0.010	0.0	0.0	0.0		
14:00	0.011	0.010	0.011	0.0	0.0	0.0		
14:15	0.011	0.010	0.013	0.0	0.0	0.0		
14:30	0.013	0.011	0.012	0.0	0.0	0.0		
14:45	0.011	0.010	0.012	0.0	0.0	0.0		
15:00	0.011	0.011	0.010	0.0	0.0	0.0		
15:15	0.011	0.011	0.009	0.0	0.0	0.0		
15:30	0.011	0.011	0.010	0.0	0.0	0.0		
15:45	0.012	0.011	0.009	0.0	0.0	0.0		
16:00	0.010	0.010	0.008	0.0	0.0	0.0		
16:15	0.011	0.010	0.012	0.0	0.0	0.0		
16:30	0.011	0.010	0.010	0.0	0.0	0.0		
16:45	0.014	0.012	0.013	0.0	0.0	0.0		
17:00	0.011	0.012	0.009	0.0	0.0	0.0		
17:15	0.010	0.009	0.007	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	152
NYSDEC Site	NYSDEC Site 224136	Date	3/11/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	36-44°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering,	Wind Direction	From N to S up to 12 mph
Weather	Rain/Snow, Cloudy	Personnel on Site	S. Comisso
Humidity	92%	Time on Site	9:00am to 5:00pm

Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 13.70 ft and water detected at 13.72 ft. Approximately 0.80 gallons of LNAPL recovered to date.
- Contractor housekeeping on-Site for sheet pile installation.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ													Totals:
Today:	0 load	0 tons												
Total:	<u>10</u> loads	<u>120</u> tons												

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at one upwind and two downwind locations on-site from 9:00am to 4:45 pm. No intrusive work conducted in OU-2. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.

Activities Planned for Coming Week:


- Demobilize and restore sidewalk in OU-2 work area.
- Install monitoring wells near OU-2 LNAPL barrier wall.
- Continue installation of sheet pile walls in OU-1.

Site Photographs:



Photo 1: View of OU-2 work area facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwaichob - 1/25/2023 1:10:37 PM

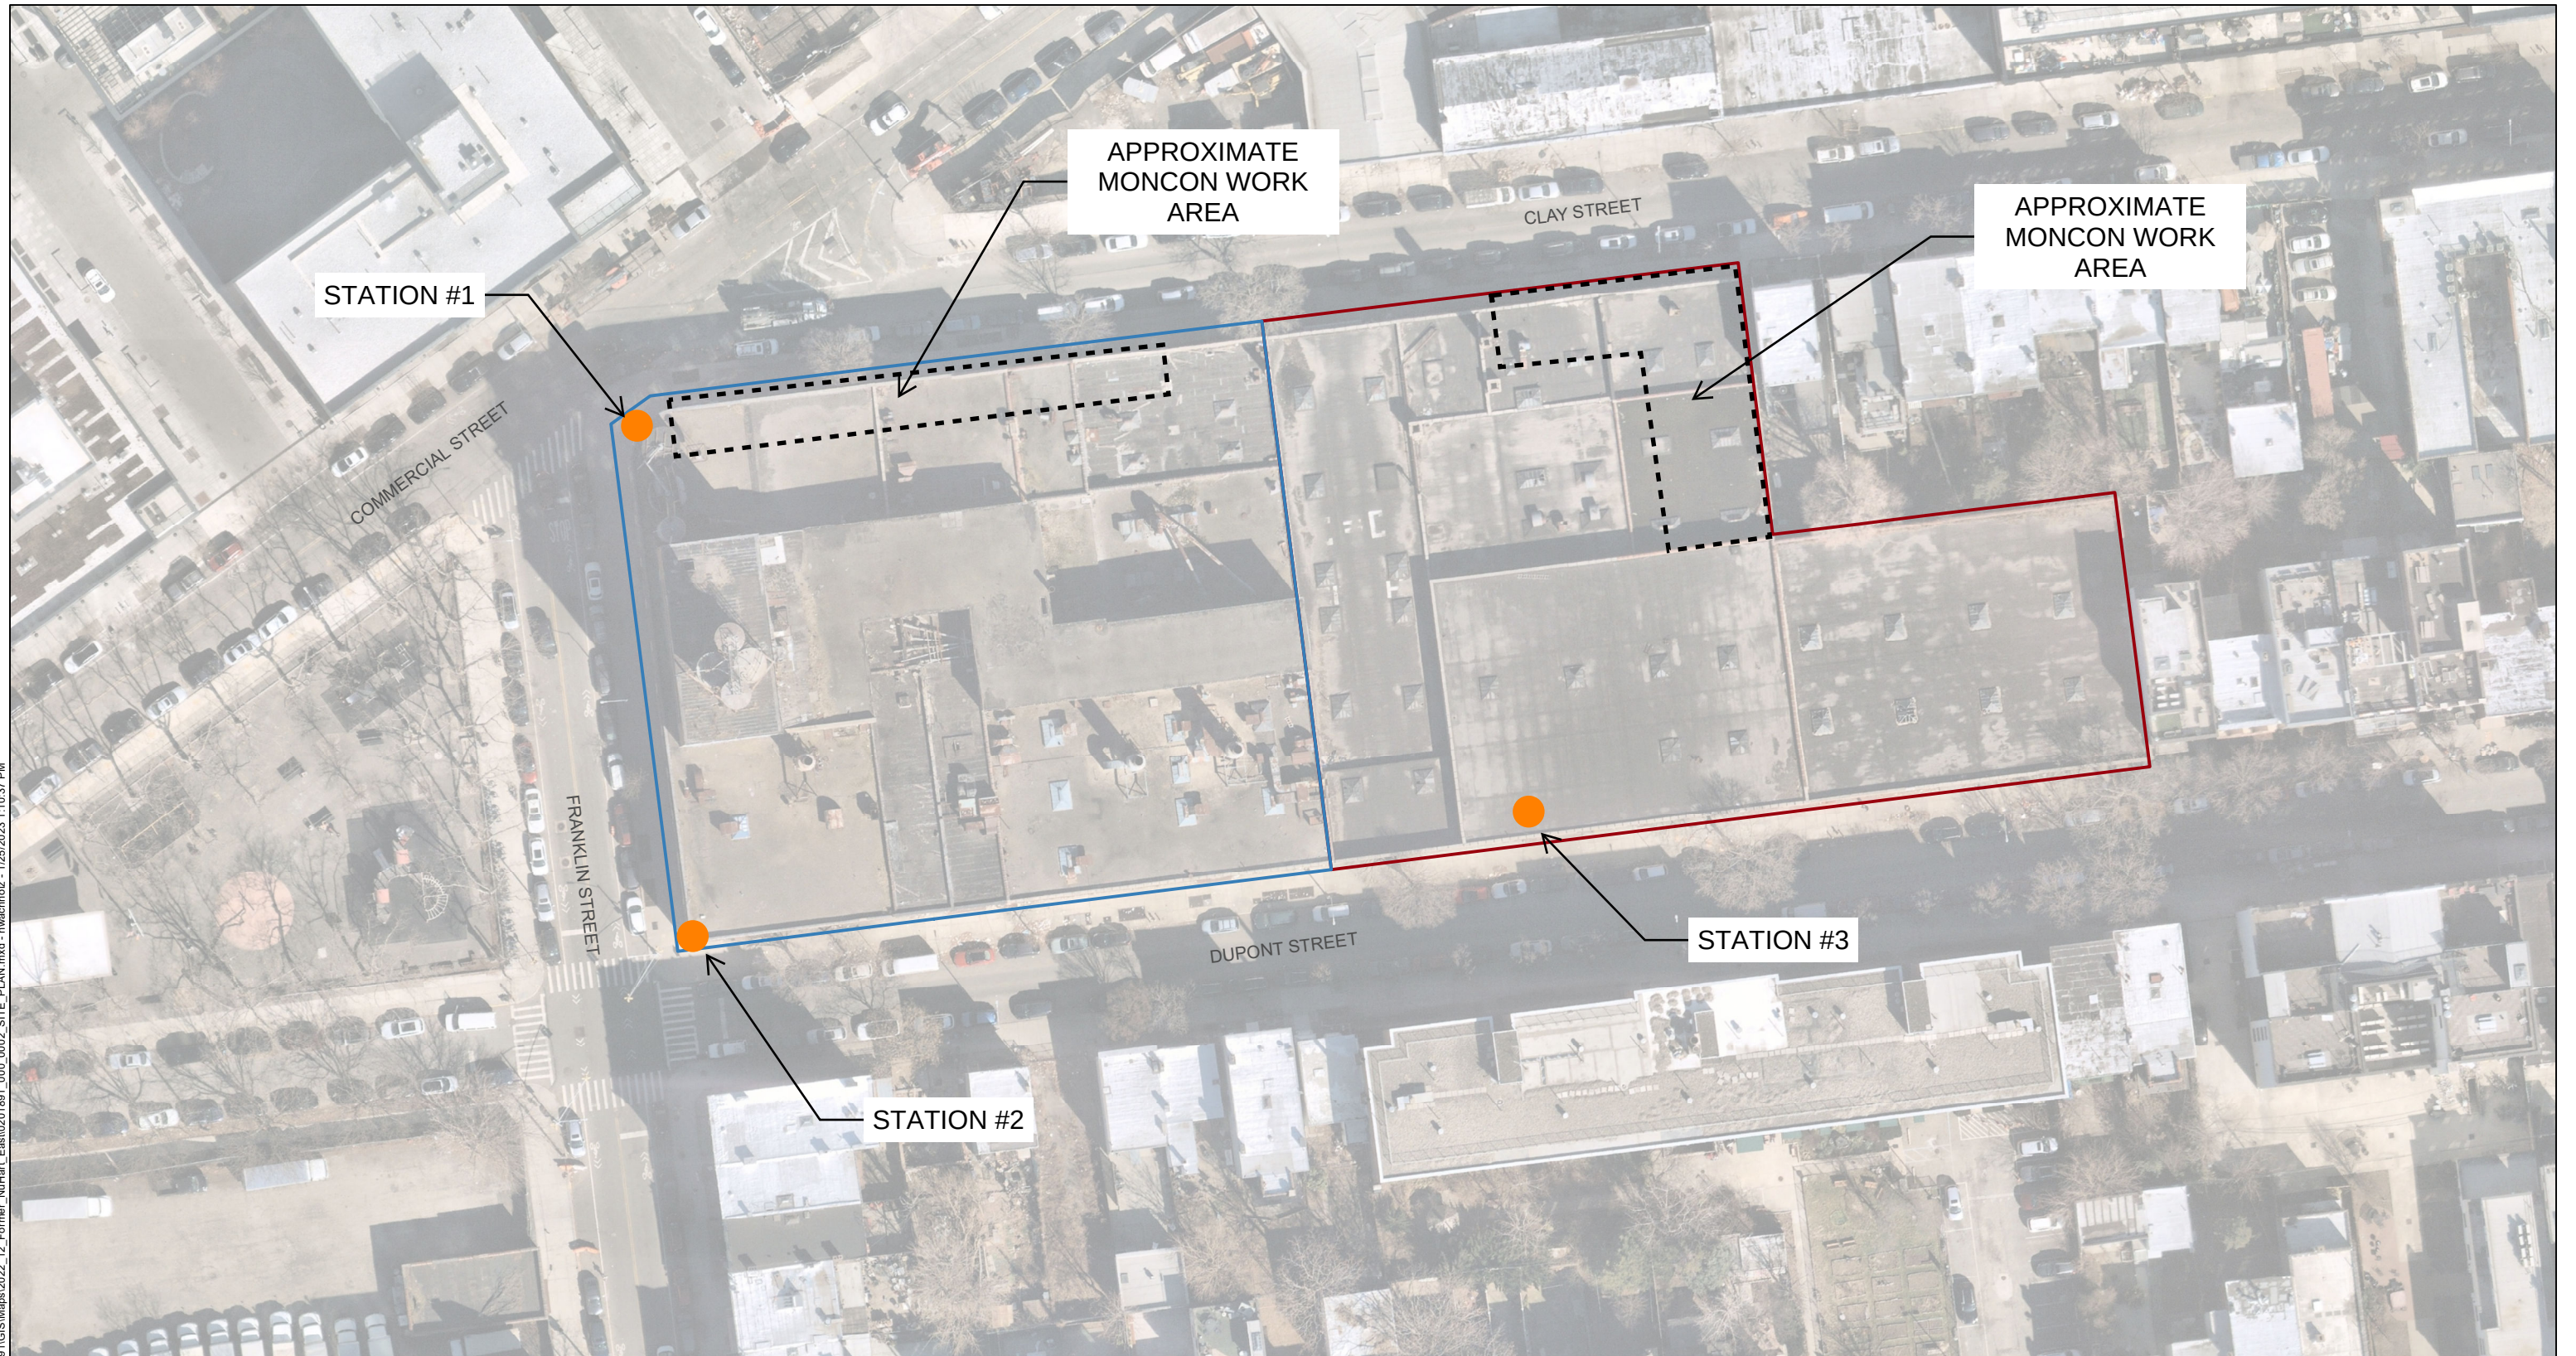

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

FEBRUARY 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log
On-Site (OU-1) Work Activities

Date : 2023-03-11

Personnel : S. Commisso
Weather : 36-44°F, Cloudy - Rain/Snow
Humidity : 92%
Wind Direction : N to S

Particulate Background (mg/m³) : 0.005
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. VOC (Station1)	Avg. VOC (Station2)	Avg. VOC (Station3)	Odors	Notes Activities/ Additional Monit..
09:00	0.005	0.008	0.005	0.0	0.0	0.0		
09:15	0.005	0.007	0.005	0.0	0.0	0.0		
09:30	0.005	0.007	0.004	0.0	0.0	0.0		
09:45	0.005	0.007	0.004	0.0	0.0	0.0		
10:00	0.005	0.008	0.004	0.0	0.0	0.0		
10:15	0.005	0.007	0.003	0.0	0.0	0.0		
10:30	0.006	0.008	0.004	0.0	0.0	0.0		
10:45	0.018	0.007	0.004	0.0	0.0	0.0		
11:00	0.006	0.008	0.005	0.0	0.0	0.0		
11:15	0.006	0.008	0.004	0.0	0.0	0.0		
11:30	0.017	0.008	0.005	0.0	0.0	0.0		
11:45	0.037	0.008	0.005	0.0	0.0	0.0		
12:00	0.009	0.008	0.005	0.0	0.0	0.0		
12:15	0.008	0.008	0.004	0.0	0.0	0.0		
12:30	0.012	0.009	0.005	0.0	0.0	0.0		
12:45	0.007	0.008	0.004	0.0	0.0	0.0		
13:00	0.007	0.008	0.004	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. VOC (Station1)	Avg. VOC (Station2)	Avg. VOC (Station3)	Odors	Notes Activities/ Additional Monitoring
13:15	0.007	0.008	0.004	0.0	0.0	0.0		
13:30	0.007	0.008	0.005	0.0	0.0	0.0		
13:45	0.007	0.008	0.004	0.0	0.0	0.0		
14:00	0.007	0.008	0.005	0.0	0.0	0.0		
14:15	0.035	0.008	0.005	0.0	0.0	0.0		
14:30	0.100	0.010	0.006	0.0	0.0	0.0		
14:45	0.014	0.007	0.005	0.0	0.0	0.0		
15:00	0.010	0.007	0.005	0.0	0.0	0.0		
15:15	0.013	0.007	0.005	0.0	0.0	0.0		
15:30	0.010	0.007	0.006	0.0	0.0	0.0		
15:45	0.008	0.007	0.004	0.0	0.0	0.0		
16:00	0.008	0.008	0.004	0.0	0.0	0.0		
16:15	0.008	0.008	0.005	0.0	0.0	0.0		
16:30	0.007	0.008	0.005	0.0	0.0	0.0		
16:45	0.008	0.007	0.007	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	153
NYSDEC Site	NYSDEC Site 224136	Date	3/13/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	36-44°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering, Lakewood Environmental Services Corp. (Lakewood)	Wind Direction	From NE to SW up to 6 mph
Weather	Rain, Cloudy	Personnel on Site	S. Sotomayor
Humidity	56%	Time on Site	7:00am to 6:00pm

Haley & Aldrich of New York (Haley & Aldrich) was present to document the installation of the on-site (OU-1) sheet pile walls, gauge accessible monitoring wells along Franklin and Dupont Street, and install three monitoring wells in OU-2. Site Observations are summarized below.

Daily Observations:

- Contractor mobilized tools and equipment within OU-1 work areas.
- Contractor prepared for and continued installation of OU-1 sheet pile walls.
- Lakewood mobilized Geoprobe drill rig and installed three monitoring wells within OU-2 work area.
- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in well MW-24 at 13.80 ft and water detected at 13.82 ft. Approximately 0.8 gallons of LNAPL recovered to date. No LNAPL detected in three newly installed monitoring wells.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ												Totals:
Today:	0 load	0 tons											
Total:	<u>10 loads</u>	<u>120 tons</u>											

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at one upwind and one downwind location during ground intrusive activities in OU-2 from 7:15 am to 5:15 pm. Community air monitoring was performed at one upwind and two downwind locations during intrusive activities in OU-1 from 7:15 am to 5:30 pm. An equipment malfunction occurred at Station #5 at 8:00 am due to heavy rain. Visual and olfactory monitoring was conducted at this location during this time and no visible dust was observed. The issue was resolved by 9:45 am. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.

Activities Planned for Coming Week:

- Demobilize and restore sidewalk in OU-2 work area.
- Continue installation of sheet pile walls in OU-1.


Site Photographs:

Photo 1: View of OU-2 monitoring well installation facing north.



Photo 2: View of OU-1 sheet pile wall installation facing south.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\0201891_000_0002_SITE_PLAN.mxd - hwalcholz - 1/25/2023 1:10:37 PM

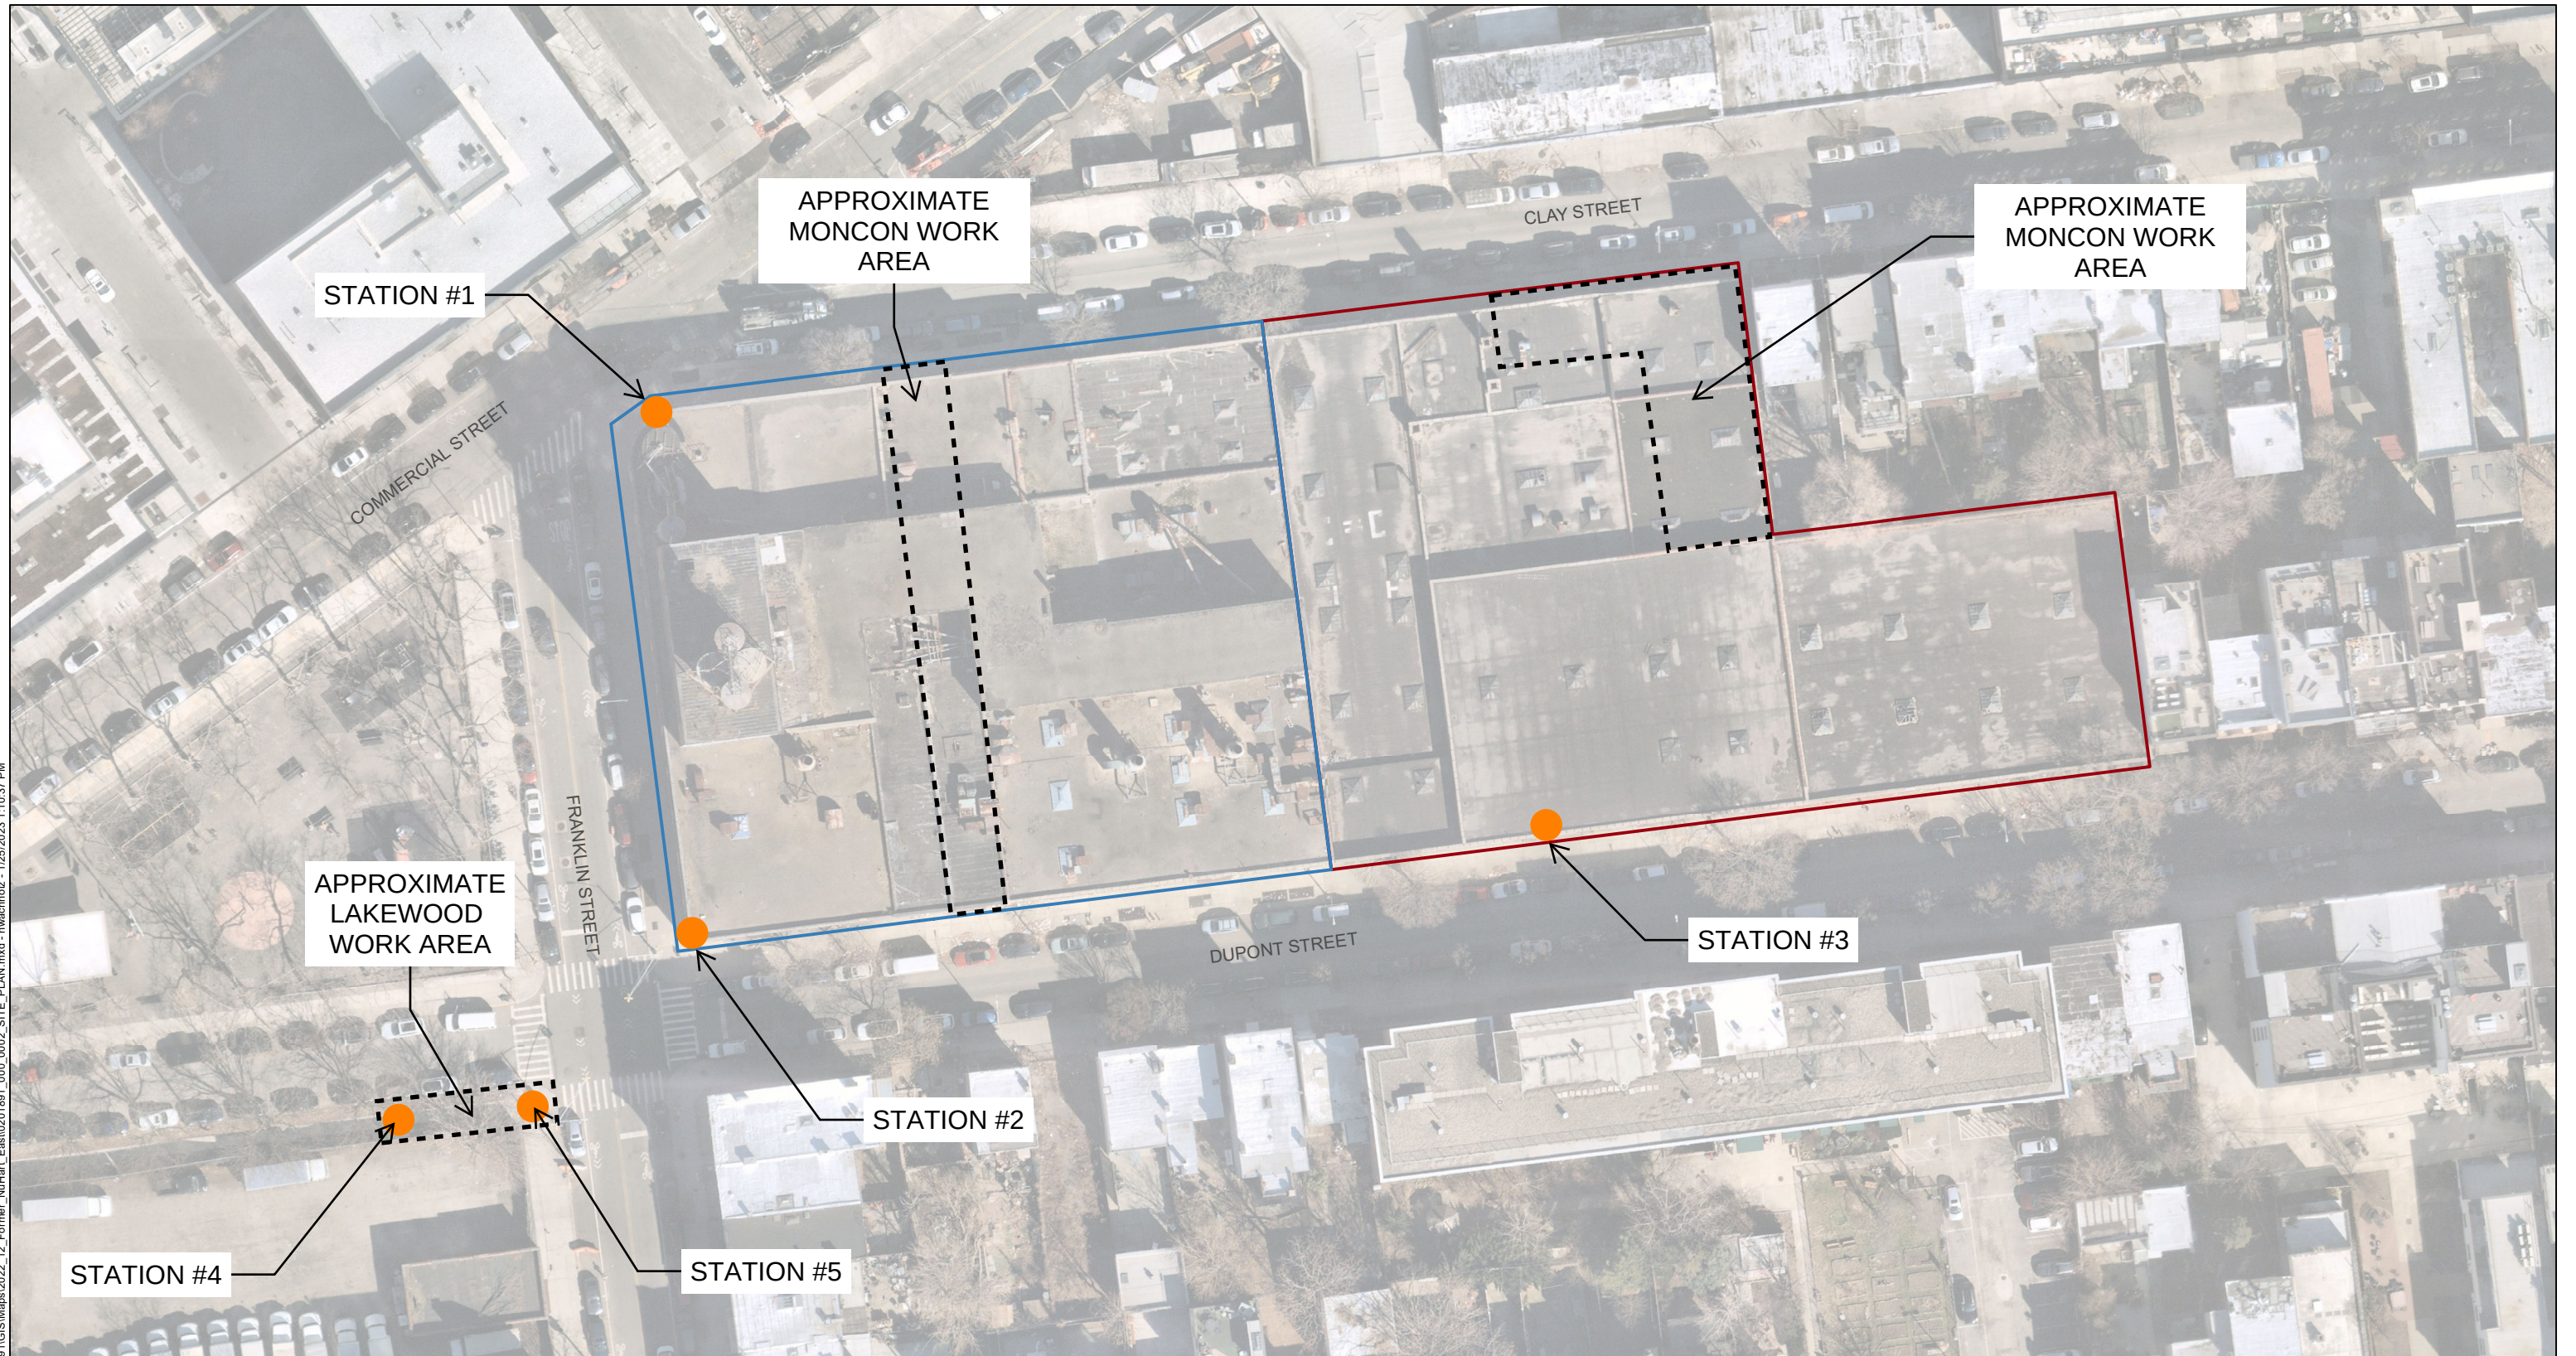

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

FEBRUARY 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log
On-Site (OU-1) Work Activities

Date : 2023-03-13

Personnel : S. Sotomayor
Weather : 36-44°F, Rain / Cloudy
Humidity : 56%
Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.013
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. VOC (Station1)	Avg. VOC (Station2)	Avg. VOC (Station3)	Odors	Notes Activities/ Additional Monit..
07:15	0.016	0.013	0.013	0.0	0.0	0.0		
07:30	0.012	0.012	0.010	0.0	0.0	0.0		
07:45	0.010	0.011	0.008	0.0	0.0	0.0		
08:00	0.010	0.011	0.009	0.0	0.0	0.0		
08:15	0.010	0.011	0.010	0.0	0.0	0.0		
08:30	0.011	0.011	0.009	0.0	0.0	0.0		
08:45	0.010	0.011	0.009	0.0	0.0	0.0		
09:00	0.010	0.011	0.008	0.0	0.0	0.0		
09:15	0.011	0.011	0.008	0.0	0.0	0.0		
09:30	0.010	0.011	0.009	0.0	0.0	0.0		
09:45	0.011	0.011	0.009	0.0	0.0	0.0		
10:00	0.010	0.011	0.009	0.0	0.0	0.0		
10:15	0.011	0.011	0.009	0.0	0.0	0.0		
10:30	0.012	0.013	0.010	0.0	0.0	0.0		
10:45	0.015	0.013	0.011	0.0	0.0	0.0		
11:00	0.016	0.014	0.013	0.0	0.0	0.0		
11:15	0.015	0.014	0.013	0.0	0.0	0.0		
11:30	0.015	0.014	0.012	0.0	0.0	0.0		
11:45	0.015	0.014	0.013	0.0	0.0	0.0		
12:00	0.017	0.014	0.013	0.0	0.0	0.0		
12:15	0.016	0.013	0.014	0.0	0.0	0.0		
12:30	0.013	0.013	0.012	0.0	0.0	0.0		
12:45	0.014	0.012	0.011	0.0	0.0	0.0		
13:00	0.013	0.012	0.011	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. VOC (Station1)	Avg. VOC (Station2)	Avg. VOC (Station3)	Odors	Notes Activities/ Additional Monitoring
13:15	0.011	0.011	0.010	0.0	0.0	0.0		
13:30	0.011	0.011	0.010	0.0	0.0	0.0		
13:45	0.011	0.011	0.010	0.0	0.0	0.0		
14:00	0.011	0.011	0.010	0.0	0.0	0.0		
14:15	0.010	0.011	0.009	0.0	0.0	0.0		
14:30	0.010	0.011	0.009	0.0	0.0	0.0		
14:45	0.012	0.011	0.010	0.0	0.0	0.0		
15:00	0.014	0.012	0.010	0.0	0.0	0.0		
15:15	0.011	0.011	0.009	0.0	0.0	0.0		
15:30	0.011	0.012	0.010	0.0	0.0	0.0		
15:45	0.012	0.011	0.009	0.0	0.0	0.0		
16:00	0.011	0.011	0.010	0.0	0.0	0.0		
16:15	0.011	0.011	0.009	0.0	0.0	0.0		
16:30	0.010	0.011	0.009	0.0	0.0	0.0		
16:45	0.010	0.010	0.008	0.0	0.0	0.0		
17:00	0.010	0.011	0.008	0.0	0.0	0.0		
17:15	0.010	0.010	0.008	0.0	0.0	0.0		
17:30	0.009	0.010	0.008	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log
Off-Site OU-2 LNAPL Barrier Wall Installation

Date : 2023-03-13

Personnel : S. Sotomayor
Weather : 36-44°F, Rain / Cloudy
Humidity : 56%
Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.025

PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station4)	Avg. PM10 (Station5)	Avg. VOC (Station4)	Avg. VOC (Station5)	Odors	Notes Activities/Additional Monitoring
07:15	0.026	0.025	0.0	0.0		
07:30	0.022	0.022	0.0	0.0		
07:45	0.021	0.020	0.0	0.0		
08:00	0.026		0.0			Equipment malfunction at Station #5 due to heavy rain. Visual and olfactory monitoring conducted at this location during this time and no visible dust observed. Troubleshoot with technician and equipment running by 9:45 am. Same issue due to rain at Station #4 at 9:30 am and issue resolved.
08:15	0.062		0.1			
08:30	0.024		0.0			
08:45	0.028		0.0			
09:00	0.041		0.1			
09:15	0.027		0.0			
09:30						
09:45	0.024	0.024	0.0	0.0		
10:00	0.022	0.022	0.0	0.0		
10:15	0.022	0.020	0.0	0.0		
10:30	0.023	0.020	0.0	0.0		
10:45	0.024	0.020	0.0	0.0		
11:00	0.025	0.021	0.0	0.0		
11:15	0.027	0.020	0.0	0.0		
11:30	0.025	0.021	0.0	0.0		
11:45	0.026	0.020	0.0	0.0		
12:00	0.026	0.020	0.0	0.0		
12:15	0.027	0.019	0.0	0.0		
12:30	0.025	0.020	0.0	0.0		
12:45	0.024	0.020	0.0	0.0		
13:00	0.024	0.018	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station4)	Avg. PM10 (Station5)	Avg. VOC (Station4)	Avg. VOC (Station5)	Odors	Notes Activities/Additional Monitoring
13:15	0.023	0.020	0.0	0.0		
13:30	0.023	0.020	0.0	0.0		
13:45	0.023	0.019	0.0	0.0		
14:00	0.023	0.020	0.0	0.0		
14:15	0.022	0.020	0.0	0.0		
14:30	0.022	0.020	0.0	0.0		
14:45	0.024	0.019	0.0	0.0		
15:00	0.023	0.019	0.0	0.0		
15:15	0.023	0.019	0.0	0.0		
15:30	0.023	0.019	0.0	0.0		
15:45	0.022	0.019	0.0	0.0		
16:00	0.023	0.020	0.0	0.0		
16:15	0.022	0.019	0.0	0.0		
16:30	0.022	0.018	0.0	0.0		
16:45	0.021	0.019	0.0	0.0		
17:00	0.021	0.018	0.0	0.0		
17:15	0.022	0.018	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	154
NYSDEC Site	NYSDEC Site 224136	Date	3/14/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	36-44°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering,	Wind Direction	From NE to SW up to 16 mph
Weather	Snow, Overcast	Personnel on Site	S. Sotomayor
Humidity	85%	Time on Site	7:00am to 3:30pm

Haley & Aldrich of New York (Haley & Aldrich) was present to document the installation of the on-site (OU-1) sheet pile walls, and gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Contractor mobilized tools and equipment within OU-1 work areas.
- Contractor prepared for and continued installation of OU-1 sheet pile walls.
- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in well MW-24 at 13.75 ft and water detected at 13.77 ft. Approximately 0.8 gallons of LNAPL recovered to date. No LNAPL detected in newly installed monitoring wells MW-45, MW-46, and MW-47.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ													Totals:
Today:	0 load	0 tons												
Total:	<u>10 loads</u>	<u>120 tons</u>												

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities in OU-1 from 7:30 am to 3:15 pm. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.

Activities Planned for Coming Week:

- Demobilize and restore sidewalk in OU-2 work area.
- Continue installation of sheet pile walls in OU-1.


Site Photographs:

Photo 1: View of OU-1 sheet pile wall installation facing southwest.



Photo 2: Alternative view of OU-1 sheet pile wall installation facing southeast.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwaichob - 1/25/2023 1:10:37 PM

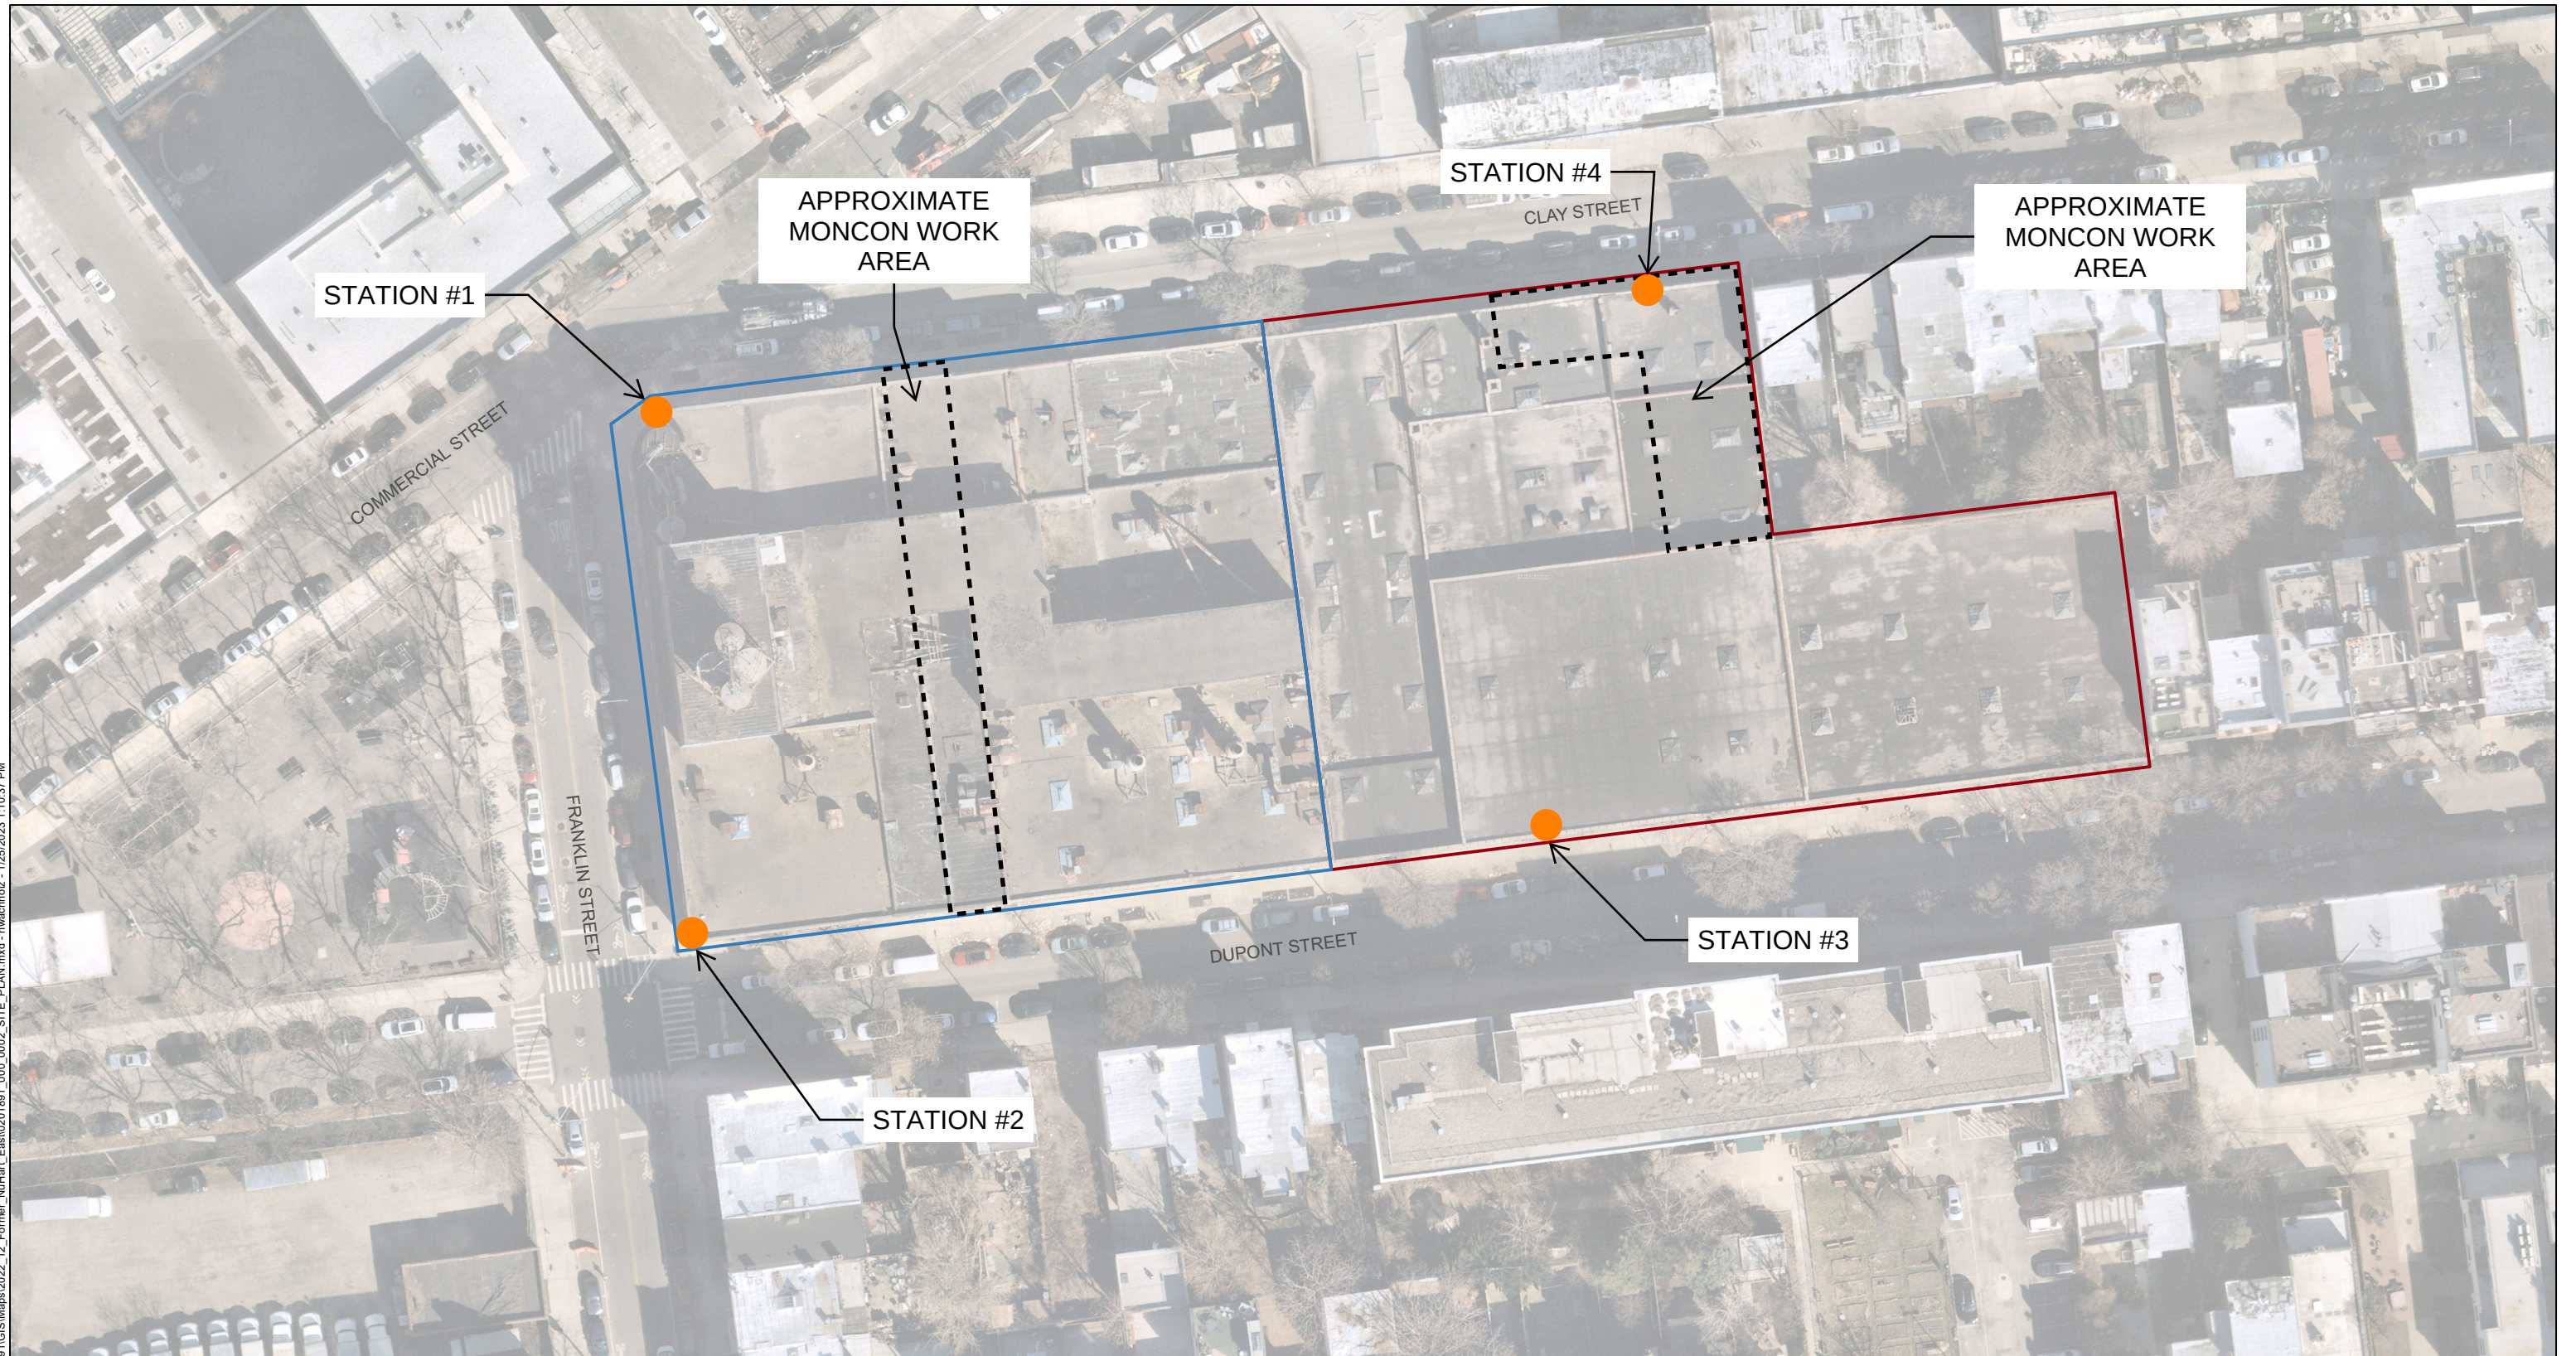

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log
On-Site (OU-1) Work Activities

Date : 2023-03-14

Personnel : S. Sotomayor
Weather : 36-44°F, Snow / Overcast
Humidity : 85%
Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.005
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:15	0.006	0.008	0.005		0.0	0.0	0.0			
07:30	0.005	0.008	0.004	0.020	0.0	0.0	0.0	0.0		
07:45	0.005	0.008	0.004	0.018	0.0	0.0	0.0	0.0		
08:00	0.005	0.007	0.004	0.019	0.0	0.0	0.0	0.0		
08:15	0.005	0.007	0.003	0.021	0.0	0.0	0.0	0.0		
08:30	0.005	0.007	0.003	0.018	0.0	0.0	0.0	0.0		
08:45	0.005	0.007	0.003	0.018	0.0	0.0	0.0	0.0		
09:00	0.005	0.007	0.003	0.019	0.0	0.0	0.0	0.0		
09:15	0.005	0.007	0.003	0.019	0.0	0.0	0.0	0.0		
09:30	0.005	0.007	0.003	0.017	0.0	0.0	0.0	0.0		
09:45	0.004	0.007	0.003	0.017	0.0	0.0	0.0	0.0		
10:00	0.004	0.007	0.003	0.017	0.0	0.0	0.0	0.0		
10:15	0.004	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
10:30	0.004	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
10:45	0.004	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
11:00	0.004	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
11:15	0.004	0.007	0.003	0.017	0.0	0.0	0.0	0.0		
11:30	0.004	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
11:45	0.004	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
12:00	0.004	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
12:15	0.004	0.012	0.003	0.016	0.0	0.0	0.0	0.0		
12:30	0.005	0.009	0.003	0.017	0.0	0.0	0.1	0.0		
12:45	0.004	0.007	0.003	0.020	0.0	0.0	0.0	0.1		
13:00	0.004	0.007	0.003	0.019	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.004	0.007	0.003	0.017	0.0	0.0	0.0	0.0		
13:30	0.004	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
13:45	0.005	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
14:00	0.005	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
14:15	0.005	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
14:30	0.005	0.007	0.003	0.017	0.0	0.0	0.0	0.0		
14:45	0.004	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
15:00	0.004	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
15:15	0.004	0.007	0.003	0.016	0.0	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	155
NYSDEC Site	NYSDEC Site 224136	Date	3/15/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	34-42°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering,	Wind Direction	From NW to SE up to 23 mph
Weather	Sunny	Personnel on Site	S. Sotomayor
Humidity	32%	Time on Site	7:00am to 6:00pm

Haley & Aldrich of New York (Haley & Aldrich) was present to document the installation of the on-site (OU-1) sheet pile walls, and gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Contractor mobilized tools and equipment within OU-1 work area.
- Contractor prepared for and continued installation of OU-1 sheet pile walls.
- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in well MW-24 at 13.71 ft and water detected at 13.73 ft. Approximately 0.8 gallons of LNAPL recovered to date. No LNAPL detected in monitoring wells MW-45, MW-46, and MW-47.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ													Totals:
Today:	0 load	0 tons												
Total:	<u>10</u> loads	<u>120</u> tons												

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities in OU-1 from 7:30 am to 5:45 pm. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.

Activities Planned for Coming Week:

- Demobilize and restore sidewalk in OU-2 work area.
- Continue installation of sheet pile walls in OU-1.



Site Photographs:

Photo 1: View of OU-1 sheet pile wall installation facing southeast.



Photo 2: Alternate view of OU-1 sheet pile wall installation facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwaichob - 1/25/2023 1:10:37 PM

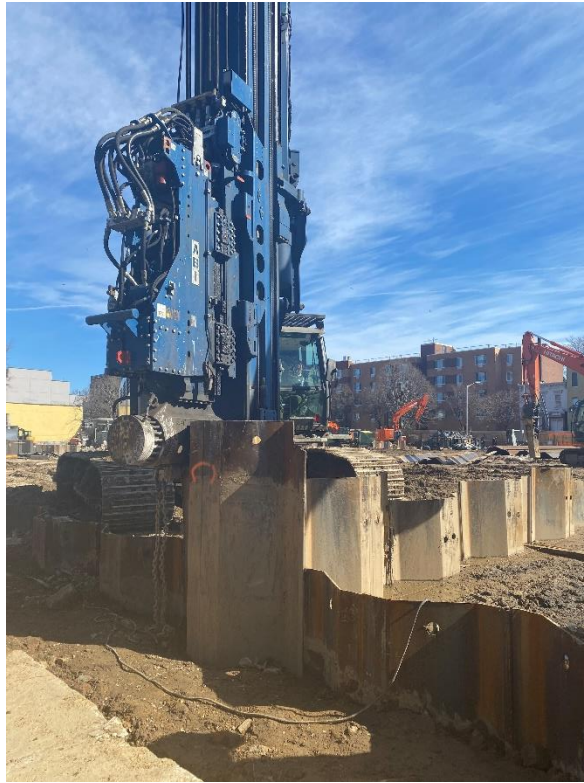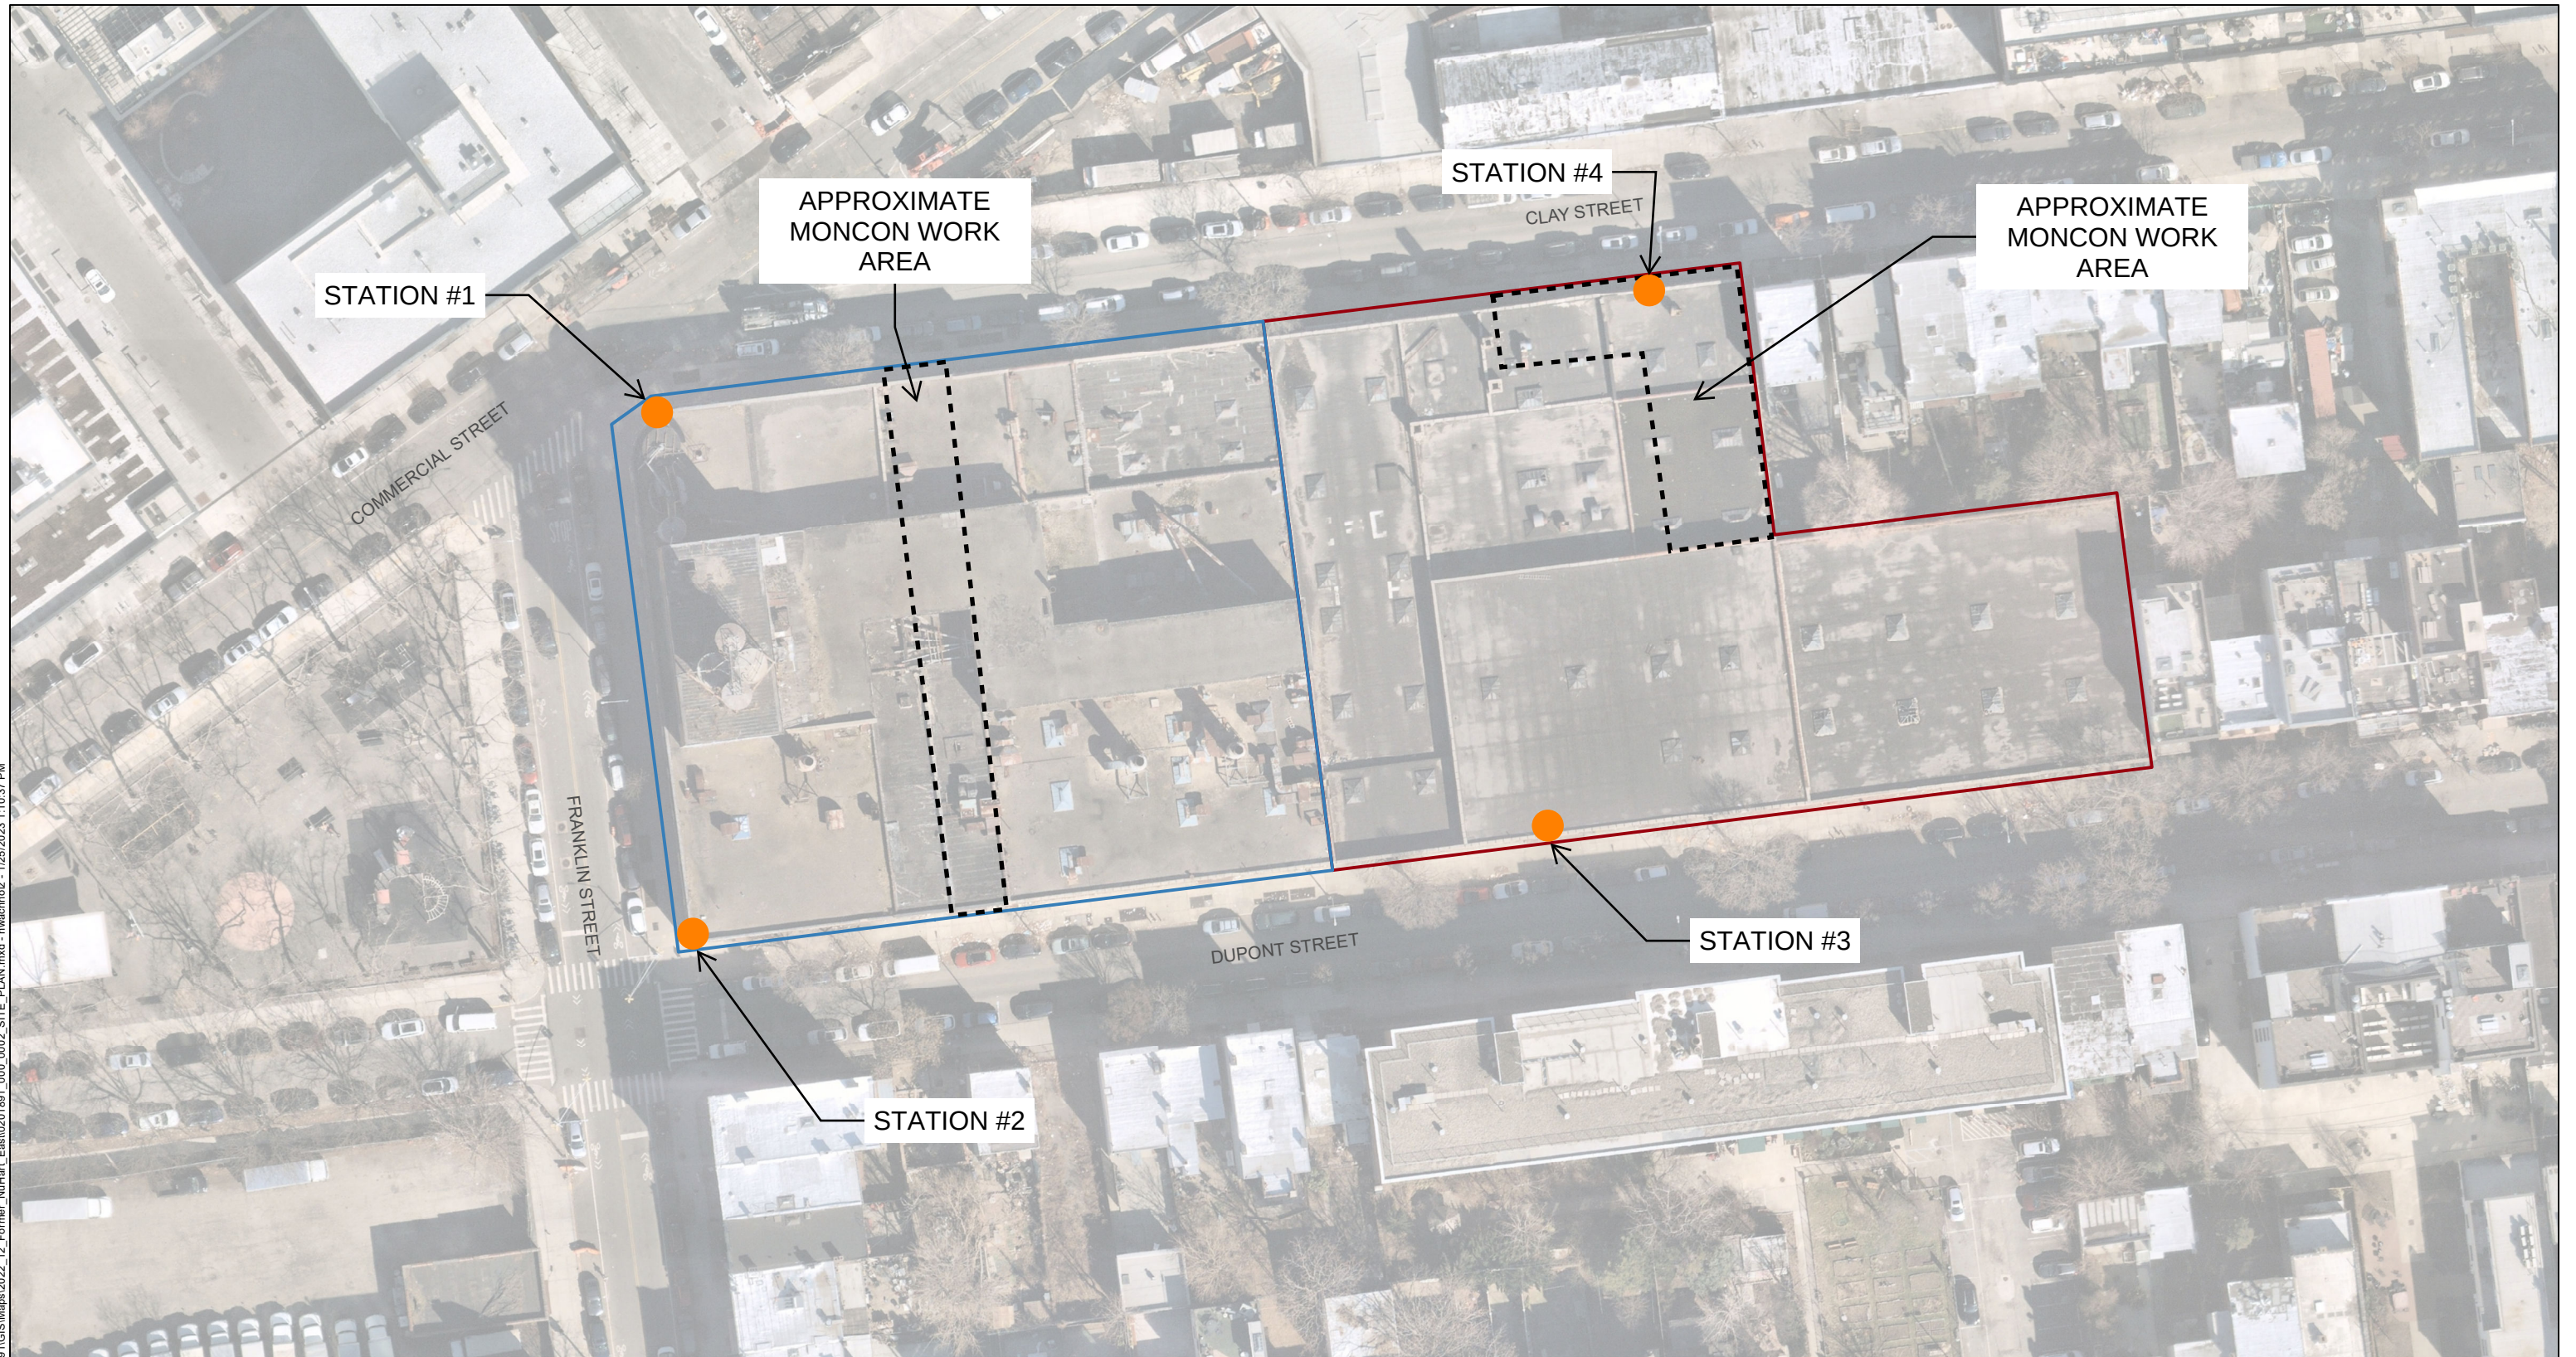

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log
On-Site (OU-1) Work Activities

Date : 2023-03-15

Personnel : S. Sotomayor
Weather : 34-42°F, Sunny
Humidity : 32%
Wind Direction : NW to SE

Particulate Background (mg/m³) : 0.005
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:30	0.005	0.009	0.003	0.018	0.0	0.0	0.0	0.0		
07:45	0.004	0.007	0.003	0.017	0.0	0.0	0.0	0.0		
08:00	0.004	0.007	0.003	0.017	0.0	0.0	0.0	0.0		
08:15	0.004	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
08:30	0.004	0.007	0.003	0.016	0.0	0.0	0.0	0.0		
08:45	0.005	0.007	0.003	0.017	0.0	0.0	0.0	0.0		
09:00	0.006	0.007	0.003	0.017	0.0	0.0	0.0	0.0		
09:15	0.005	0.007	0.003	0.019	0.0	0.0	0.0	0.0		
09:30	0.005	0.007	0.003	0.019	0.0	0.0	0.0	0.0		
09:45	0.005	0.007	0.003	0.019	0.0	0.0	0.0	0.0		
10:00	0.005	0.008	0.004	0.018	0.0	0.0	0.0	0.0		
10:15	0.005	0.007	0.004	0.017	0.0	0.0	0.0	0.0		
10:30	0.006	0.007	0.004	0.017	0.0	0.0	0.0	0.0		
10:45	0.005	0.007	0.004	0.019	0.0	0.0	0.0	0.0		
11:00	0.006	0.008	0.004	0.019	0.0	0.0	0.0	0.0		
11:15	0.005	0.008	0.005	0.019	0.0	0.0	0.0	0.0		
11:30	0.006	0.008	0.004	0.021	0.0	0.0	0.0	0.0		
11:45	0.006	0.008	0.005	0.020	0.0	0.0	0.0	0.0		
12:00	0.006	0.009	0.004	0.018	0.0	0.0	0.0	0.0		
12:15	0.006	0.011	0.004	0.019	0.0	0.0	0.0	0.0		
12:30	0.008	0.008	0.004	0.019	0.0	0.0	0.0	0.0		
12:45	0.009	0.009	0.004	0.019	0.0	0.0	0.0	0.0		
13:00	0.008	0.009	0.006	0.020	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.007	0.008	0.004	0.018	0.0	0.0	0.0	0.0		
13:30	0.006	0.008	0.004	0.019	0.0	0.0	0.0	0.0		
13:45	0.007	0.008	0.004	0.021	0.0	0.0	0.0	0.0		
14:00	0.008	0.009	0.005	0.020	0.0	0.0	0.0	0.0		
14:15	0.007	0.008	0.005	0.019	0.0	0.0	0.0	0.0		
14:30	0.008	0.009	0.005	0.020	0.0	0.0	0.0	0.0		
14:45	0.008	0.009	0.005	0.020	0.0	0.0	0.0	0.0		
15:00	0.008	0.008	0.005	0.018	0.0	0.0	0.0	0.0		
15:15	0.007	0.008	0.005	0.018	0.0	0.0	0.0	0.0		
15:30	0.009	0.009	0.006	0.018	0.0	0.0	0.0	0.0		
15:45	0.007	0.008	0.005	0.018	0.0	0.0	0.0	0.0		
16:00	0.006	0.009	0.005	0.019	0.0	0.0	0.0	0.0		
16:15	0.006	0.008	0.008	0.019	0.0	0.0	0.0	0.0		
16:30	0.017	0.008	0.006	0.026	0.0	0.0	0.0	0.0		
16:45	0.016	0.008	0.004	0.019	0.0	0.0	0.0	0.0		
17:00	0.013	0.009	0.004	0.020	0.0	0.0	0.0	0.0		
17:15	0.012	0.009	0.005	0.020	0.0	0.0	0.0	0.0		
17:30	0.010	0.008	0.006	0.022	0.0	0.0	0.0	0.0		
17:45	0.009	0.008	0.004	0.019	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to document the demobilization of the on-site (OU-2) equipment, and gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Contractor continued demobilizing equipment from OU-2.
- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in well MW-24 at 13.73 ft and water detected at 13.75 ft. Approximately 0.82 gallons of LNAPL recovered to date. No LNAPL detected in monitoring wells MW-45, MW-46, and MW-47.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Material Export:

- | | | | | | | | | | |
|--------|--------------------------------|-------------|--|--|--|--|--|--|---------|
| | Clean Earth of
Carteret, NJ | | | | | | | | Totals: |
| Today: | 0
load | 0
tons | | | | | | | |
| Total: | 10
loads | 120
tons | | | | | | | |

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

- None

- None

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities in OU-1 from 7:45 am to 5:30 pm. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.


Activities Planned for Coming Week:

- Demobilize and restore sidewalk in OU-2 work area.
- Continue installation of sheet pile walls in OU-1.

Site Photographs:

Photo 1: View of the Site facing east.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Map\2022_12_Fomer_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwaichob - 1/25/2023 1:10:37 PM

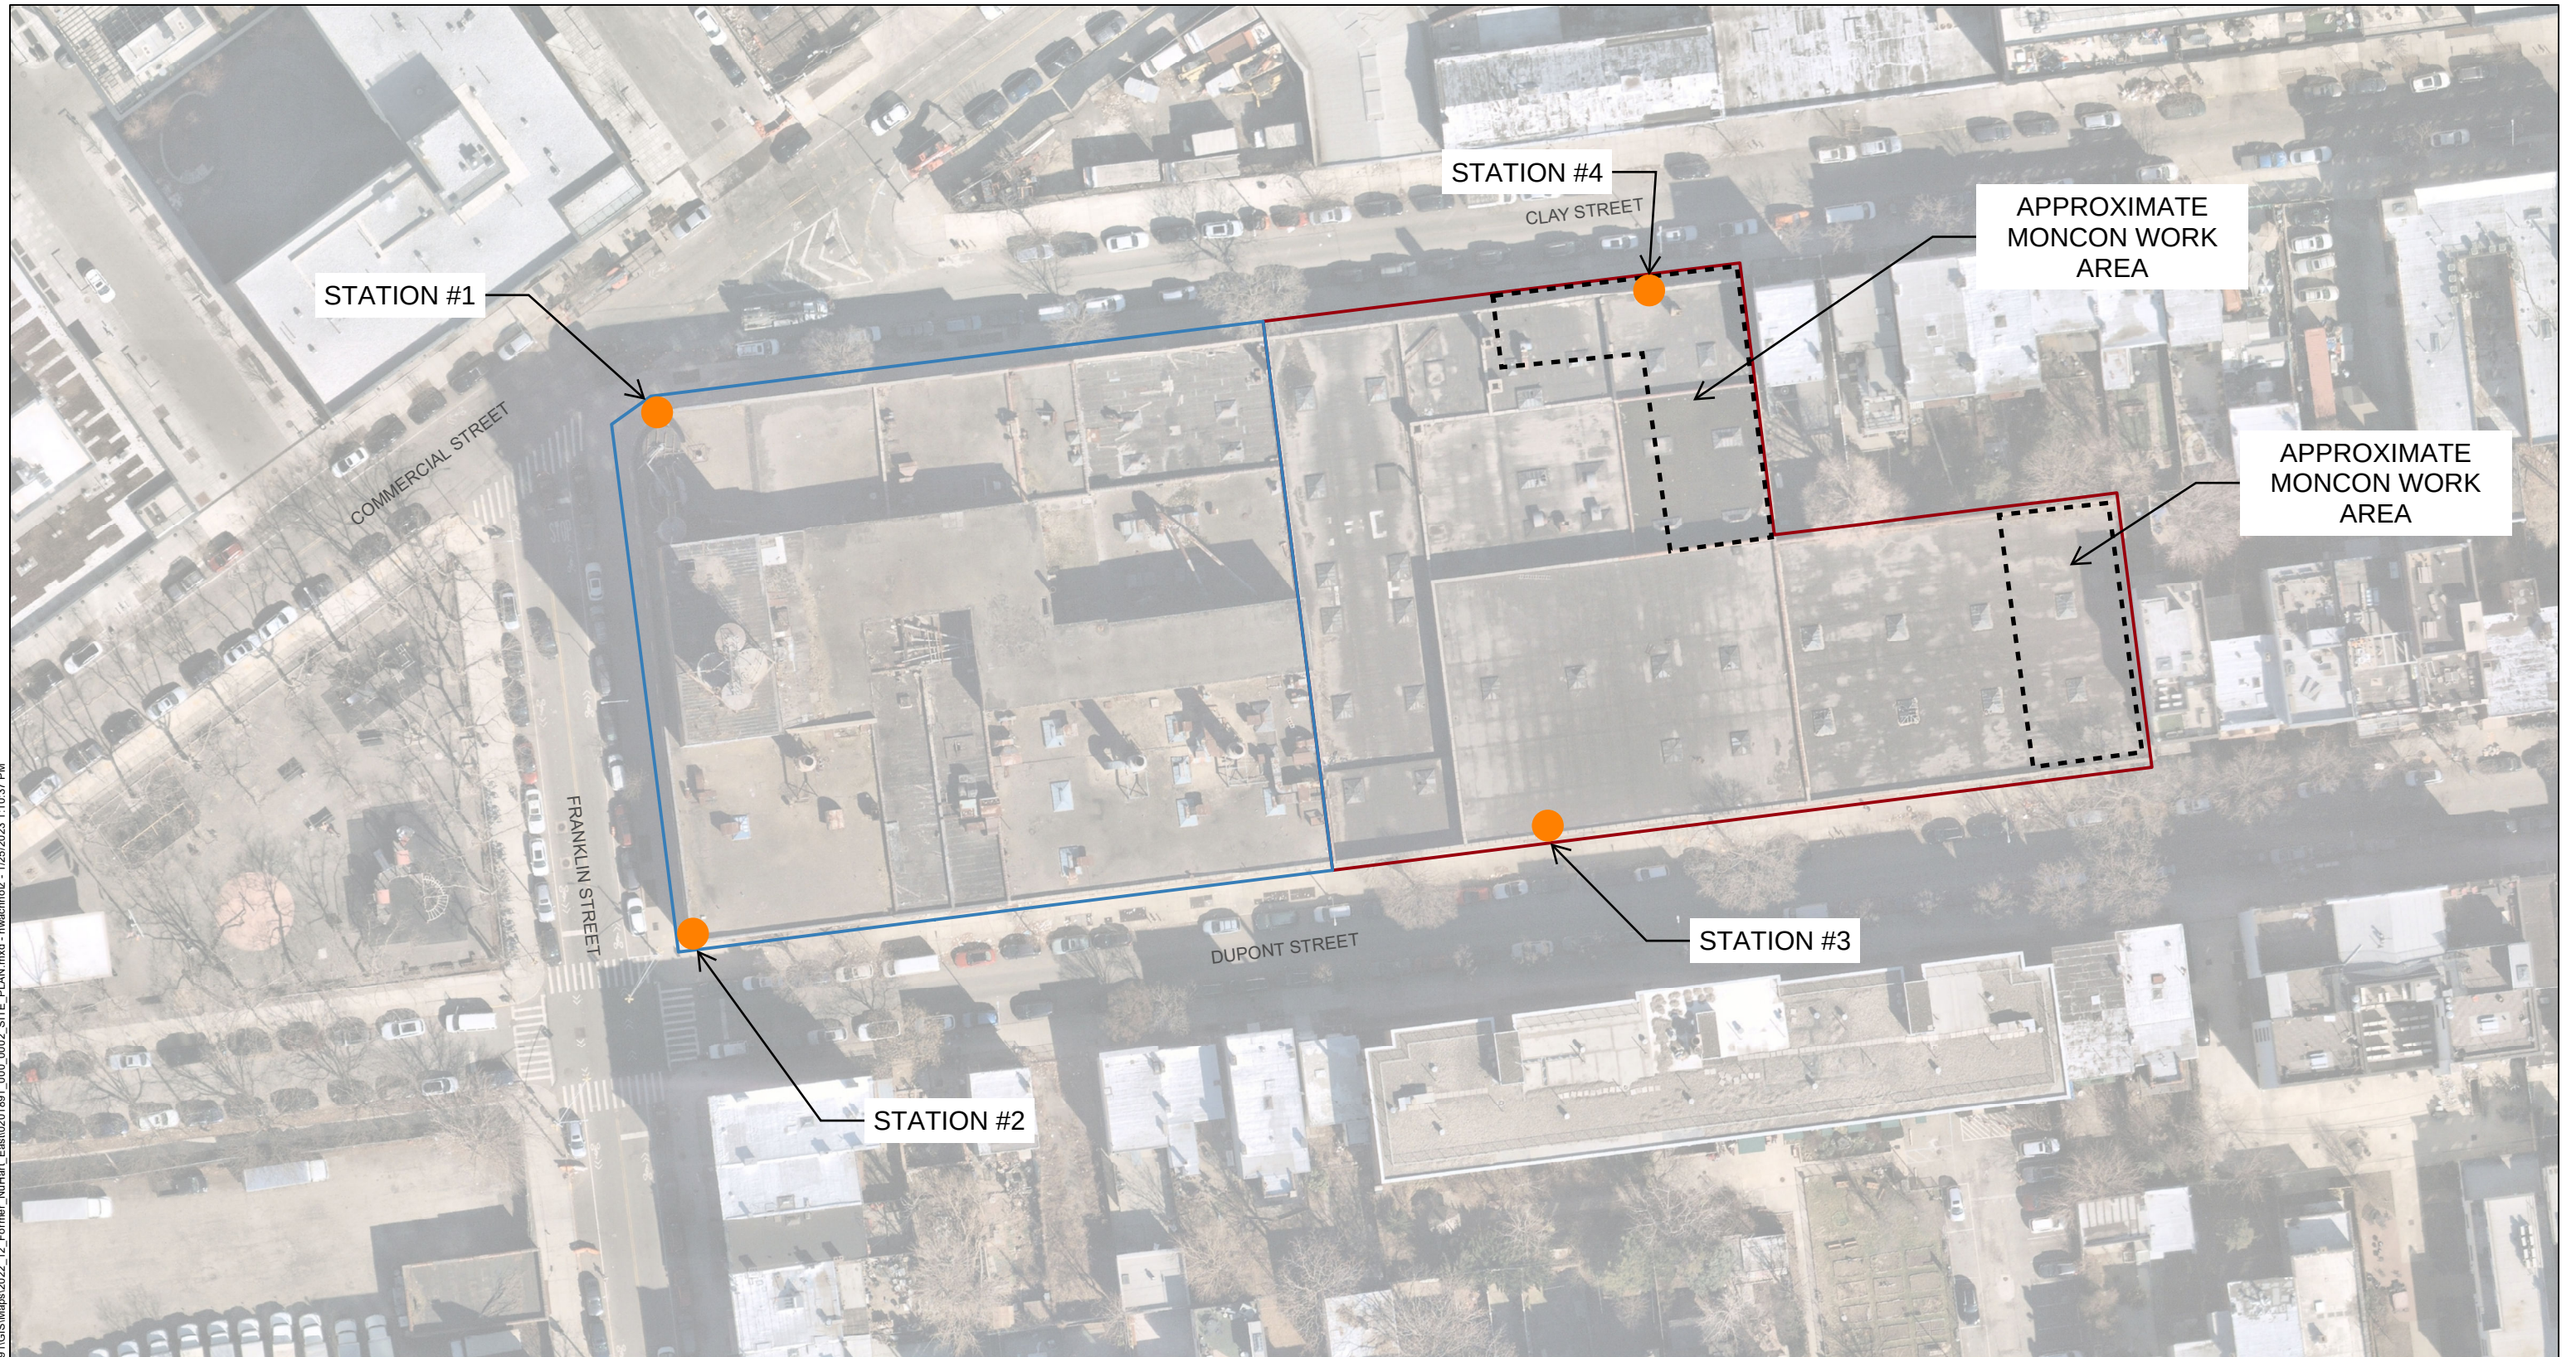


LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

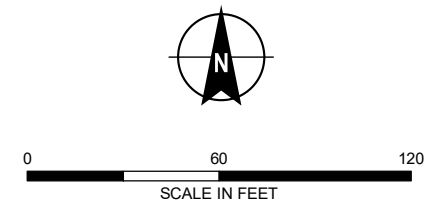

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log
On-Site (OU-1) Work Activities

Date : 2023-03-16

Personnel : S. Sotomayor
Weather : 37-43°F, Cloudy
Humidity : 45%
Wind Direction : NW to SE

Particulate Background (mg/m³) : 0.008
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:30		0.011	0.007			0.0	0.0			
07:45	0.008	0.008	0.006	0.021	0.0	0.0	0.0	0.0		
08:00	0.007	0.009	0.005	0.019	0.0	0.0	0.0	0.0		
08:15	0.007	0.008	0.005	0.021	0.0	0.0	0.0	0.0		
08:30	0.008	0.008	0.005	0.019	0.0	0.0	0.0	0.0		
08:45	0.009	0.009	0.005	0.023	0.0	0.0	0.0	0.0		
09:00	0.008	0.009	0.005	0.020	0.0	0.0	0.0	0.0		
09:15	0.008	0.013	0.007	0.021	0.0	0.0	0.0	0.0		
09:30	0.008	0.010	0.005	0.022	0.0	0.0	0.0	0.0		
09:45	0.008	0.008	0.005	0.020	0.0	0.0	0.0	0.0		
10:00	0.007	0.009	0.005	0.020	0.0	0.0	0.0	0.0		
10:15	0.007	0.009	0.005	0.019	0.0	0.0	0.0	0.0		
10:30	0.008	0.009	0.006	0.022	0.0	0.0	0.0	0.0		
10:45	0.007	0.010	0.006	0.031	0.0	0.0	0.0	0.1		
11:00	0.007	0.009	0.007	0.020	0.0	0.0	0.0	0.0		
11:15	0.008	0.010	0.006	0.021	0.0	0.0	0.0	0.0		
11:30	0.008	0.009	0.006	0.021	0.0	0.0	0.0	0.0		
11:45	0.008	0.009	0.007	0.021	0.0	0.0	0.0	0.0		
12:00	0.008	0.009	0.006	0.021	0.0	0.0	0.0	0.0		
12:15	0.008	0.009	0.006	0.021	0.0	0.0	0.0	0.0		
12:30	0.007	0.009	0.006	0.021	0.0	0.0	0.0	0.0		
12:45	0.007	0.009	0.006	0.022	0.0	0.0	0.0	0.0		
13:00	0.007	0.009	0.006	0.022	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.007	0.009	0.007	0.020	0.0	0.0	0.0	0.0		
13:30	0.007	0.009	0.007	0.019	0.0	0.0	0.0	0.0		
13:45	0.007	0.009	0.007	0.019	0.0	0.0	0.0	0.0		
14:00	0.007	0.009	0.008	0.021	0.0	0.0	0.0	0.0		
14:15	0.008	0.009	0.007	0.021	0.0	0.0	0.0	0.0		
14:30	0.007	0.010	0.007	0.022	0.0	0.0	0.0	0.0		
14:45	0.008	0.009	0.007	0.021	0.0	0.0	0.0	0.0		
15:00	0.008	0.009	0.007	0.021	0.0	0.0	0.0	0.0		
15:15	0.008	0.009	0.007	0.022	0.0	0.0	0.0	0.0		
15:30	0.008	0.009	0.007	0.021	0.0	0.0	0.0	0.0		
15:45	0.008	0.009	0.007	0.023	0.0	0.0	0.0	0.0		
16:00	0.008	0.009	0.007	0.023	0.0	0.0	0.0	0.0		
16:15	0.008	0.009	0.007	0.021	0.0	0.0	0.0	0.0		
16:30	0.008	0.009	0.007	0.022	0.0	0.0	0.0	0.0		
16:45	0.008	0.009	0.008	0.022	0.0	0.0	0.0	0.0		
17:00	0.008	0.009	0.007	0.036	0.0	0.0	0.0	0.0		
17:15	0.008	0.009	0.007	0.019	0.0	0.0	0.0	0.0		
17:30	0.008	0.009	0.007	0.019	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to document the demobilization of the on-site (OU-2) equipment, and gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Contractor continued demobilizing equipment from OU-2.
- Contractor prepped OU-1 sidewalk for restoration.
- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in well MW-24 at 13.69 ft and water detected at 13.71 ft. Approximately 0.82 gallons of LNAPL recovered to date. No LNAPL detected in monitoring wells MW-45, MW-46, and MW-47.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

- Soil/Fill disposal is summarized below:

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

- None

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities in OU-1 from 7:30 am to 4:15 pm. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.


Activities Planned for Coming Week:

- Demobilize and restore sidewalk in OU-2 work area.
- Continue installation of sheet pile walls in OU-1.

Site Photographs:

Photo 1: View of OU-2 sidewalk restoration formwork, facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwaehob - 1/25/2023 1:10:37 PM

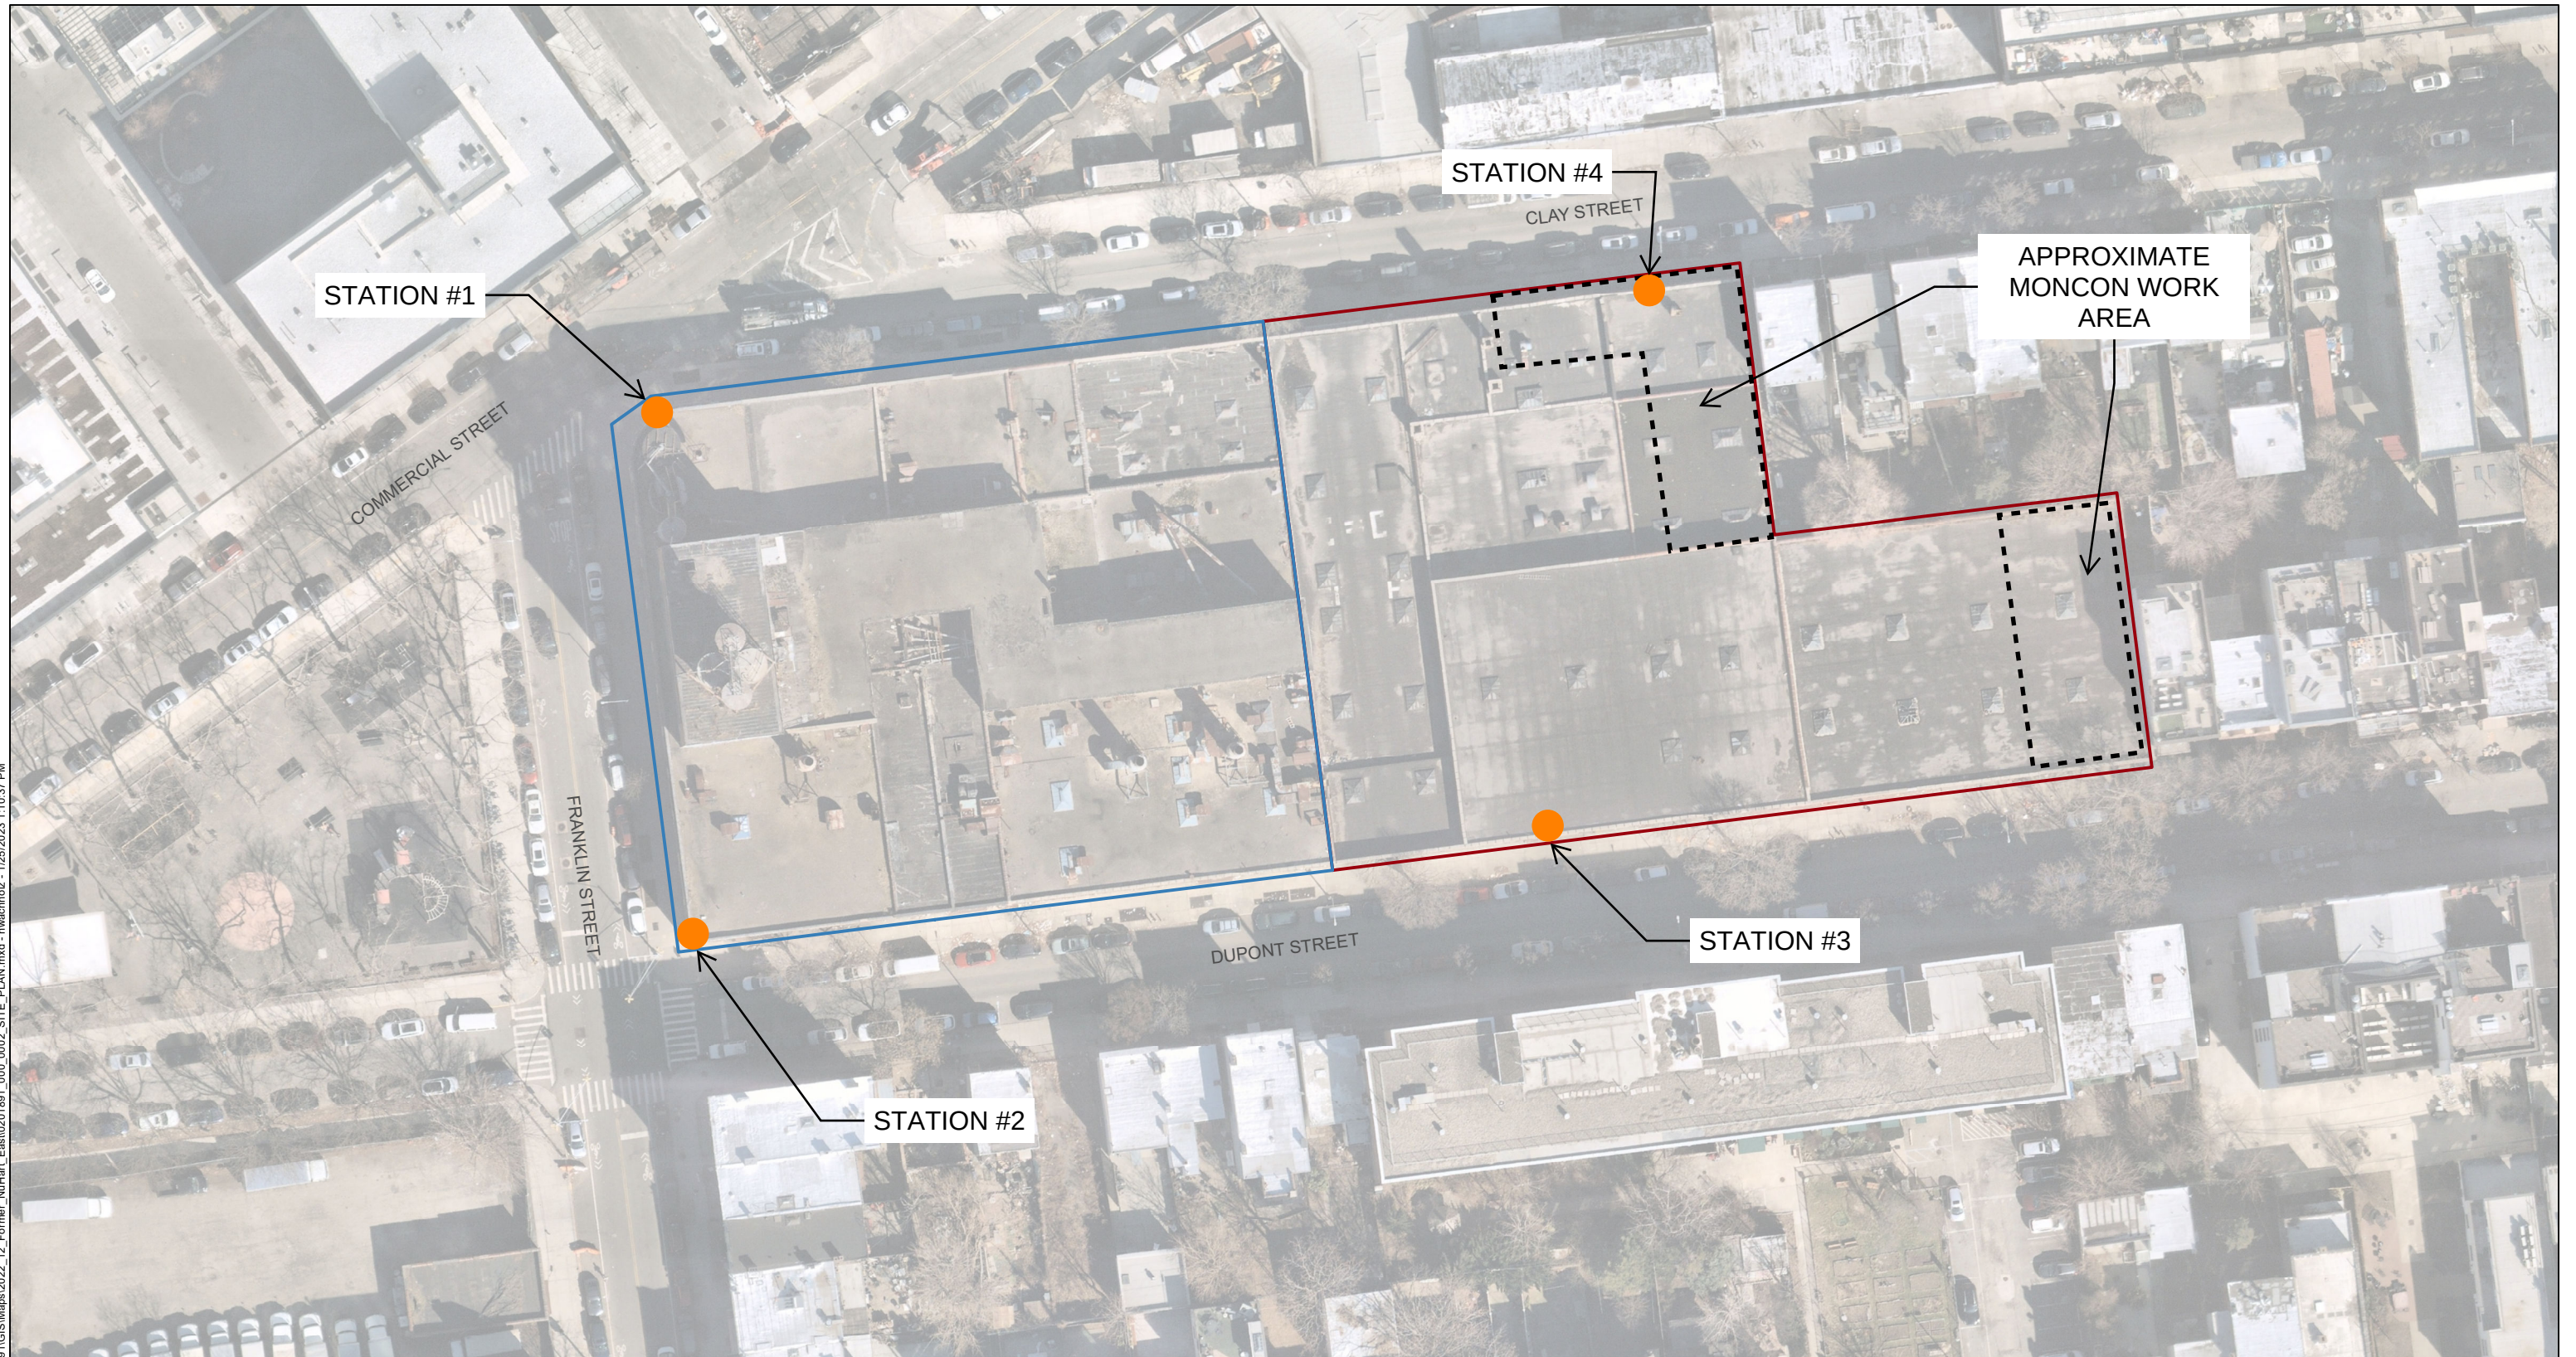


LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

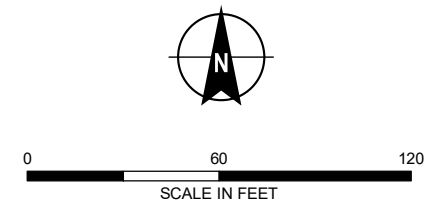

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log
On-Site (OU-1) Work Activities

Date : 2023-03-17

Personnel : S. Sotomayor
Weather : 46-51°F, Cloudy
Humidity : 59%
Wind Direction : N to S

Particulate Background (mg/m³) : 0.012
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:15	0.012	0.010	0.008		0.0	0.0	0.0			
07:30	0.011	0.010	0.008	0.021	0.0	0.0	0.0	0.0		
07:45	0.011	0.010	0.008	0.022	0.0	0.0	0.0	0.0		
08:00	0.011	0.010	0.009	0.029	0.0	0.0	0.0	0.0		
08:15	0.010	0.010	0.008	0.030	0.0	0.0	0.0	0.0		
08:30	0.011	0.015	0.009	0.044	0.0	0.0	0.0	0.0		
08:45	0.011	0.012	0.010	0.032	0.0	0.0	0.0	0.0		
09:00	0.011	0.011	0.009	0.030	0.0	0.0	0.0	0.0		
09:15	0.010	0.010	0.008	0.024	0.0	0.0	0.0	0.0		
09:30	0.011	0.011	0.009	0.024	0.0	0.0	0.0	0.0		
09:45	0.012	0.011	0.010	0.025	0.0	0.0	0.0	0.0		
10:00	0.011	0.011	0.010	0.031	0.0	0.0	0.0	0.0		
10:15	0.010	0.011	0.010	0.025	0.0	0.0	0.0	0.0		
10:30	0.011	0.010	0.011	0.026	0.0	0.0	0.0	0.0		
10:45	0.011	0.011	0.011	0.024	0.0	0.0	0.0	0.0		
11:00	0.010	0.010	0.010	0.025	0.0	0.0	0.0	0.0		
11:15	0.032	0.022	0.031	0.062	0.0	0.0	0.0	0.1		
11:30	0.026	0.017	0.023	0.040	0.0	0.0	0.0	0.0		
11:45	0.023	0.019	0.025	0.036	0.0	0.0	0.0	0.0		
12:00	0.019	0.016	0.018	0.029	0.0	0.0	0.0	0.0		
12:15	0.018	0.016	0.018	0.034	0.0	0.0	0.0	0.0		
12:30	0.012	0.012	0.011	0.031	0.0	0.0	0.0	0.0		
12:45	0.013	0.012	0.012	0.031	0.0	0.0	0.0	0.0		
13:00	0.013	0.013	0.012	0.028	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.014	0.013	0.014	0.036	0.0	0.0	0.0	0.0		
13:30	0.015	0.019	0.019	0.034	0.0	0.0	0.0	0.0		
13:45	0.015	0.013	0.016	0.029	0.0	0.0	0.0	0.0		
14:00	0.015	0.013	0.014	0.027	0.0	0.0	0.0	0.0		
14:15	0.015	0.013	0.014	0.027	0.0	0.0	0.0	0.0		
14:30	0.015	0.013	0.014	0.027	0.0	0.0	0.0	0.0		
14:45	0.017	0.013	0.015	0.026	0.0	0.0	0.0	0.0		
15:00	0.017	0.028	0.016	0.028	0.0	0.0	0.0	0.0		
15:15	0.016	0.015	0.014	0.027	0.0	0.0	0.0	0.0		
15:30	0.016	0.014	0.018	0.028	0.0	0.0	0.0	0.0		
15:45	0.016	0.014	0.014	0.028	0.0	0.0	0.0	0.0		
16:00	0.016	0.014	0.014	0.028	0.0	0.0	0.0	0.0		
16:15	0.016	0.014	0.015	0.028	0.2	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	86
NYSDEC Site	NYSDEC Site 224136	Date	3/18/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	45-54°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering,	Wind Direction	From W to E up to 9 mph
Weather	Sunny	Personnel on Site	P. DiNardo
Humidity	37%	Time on Site	9:00am to 4:45pm

Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 13.66 ft and water detected at 13.69 ft. Approximately 0.82 gallons of LNAPL recovered to date. No LNAPL detected in monitoring wells MW-45, MW-46, and MW-47.
- Contractor housekeeping on-Site for sheet pile installation.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ												Totals:
Today:	0 load	0 tons											
Total:	<u>11</u> loads	<u>132</u> tons											

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at one upwind and two downwind locations on-site from 9:00am to 4:15 pm. No intrusive work conducted in OU-2. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.

Activities Planned for Coming Week:

- Demobilize and restore sidewalk in OU-2 work area.
- Continue installation of sheet pile walls in OU-1.


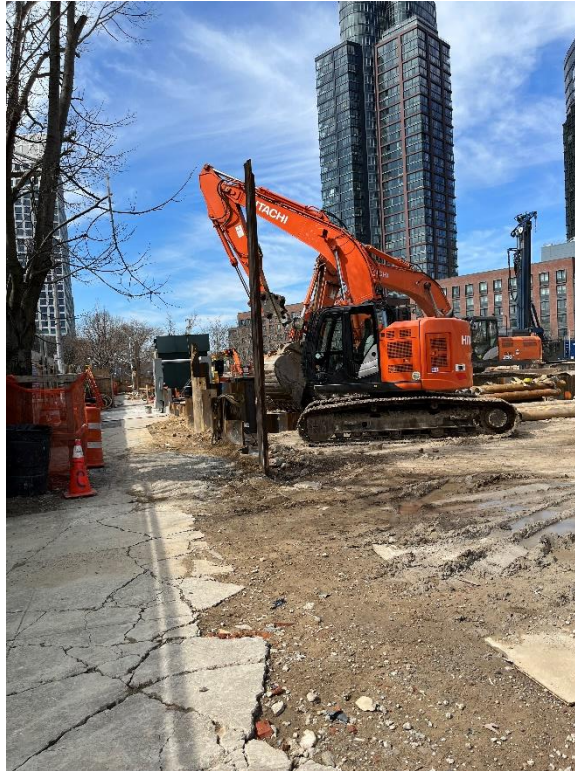
Site Photographs:

Photo 1: View of housekeeping on-Site for sheet pile installation facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\0201891_000_0002_SITE_PLAN.mxd - hwalcholz - 1/25/2023 1:10:37 PM

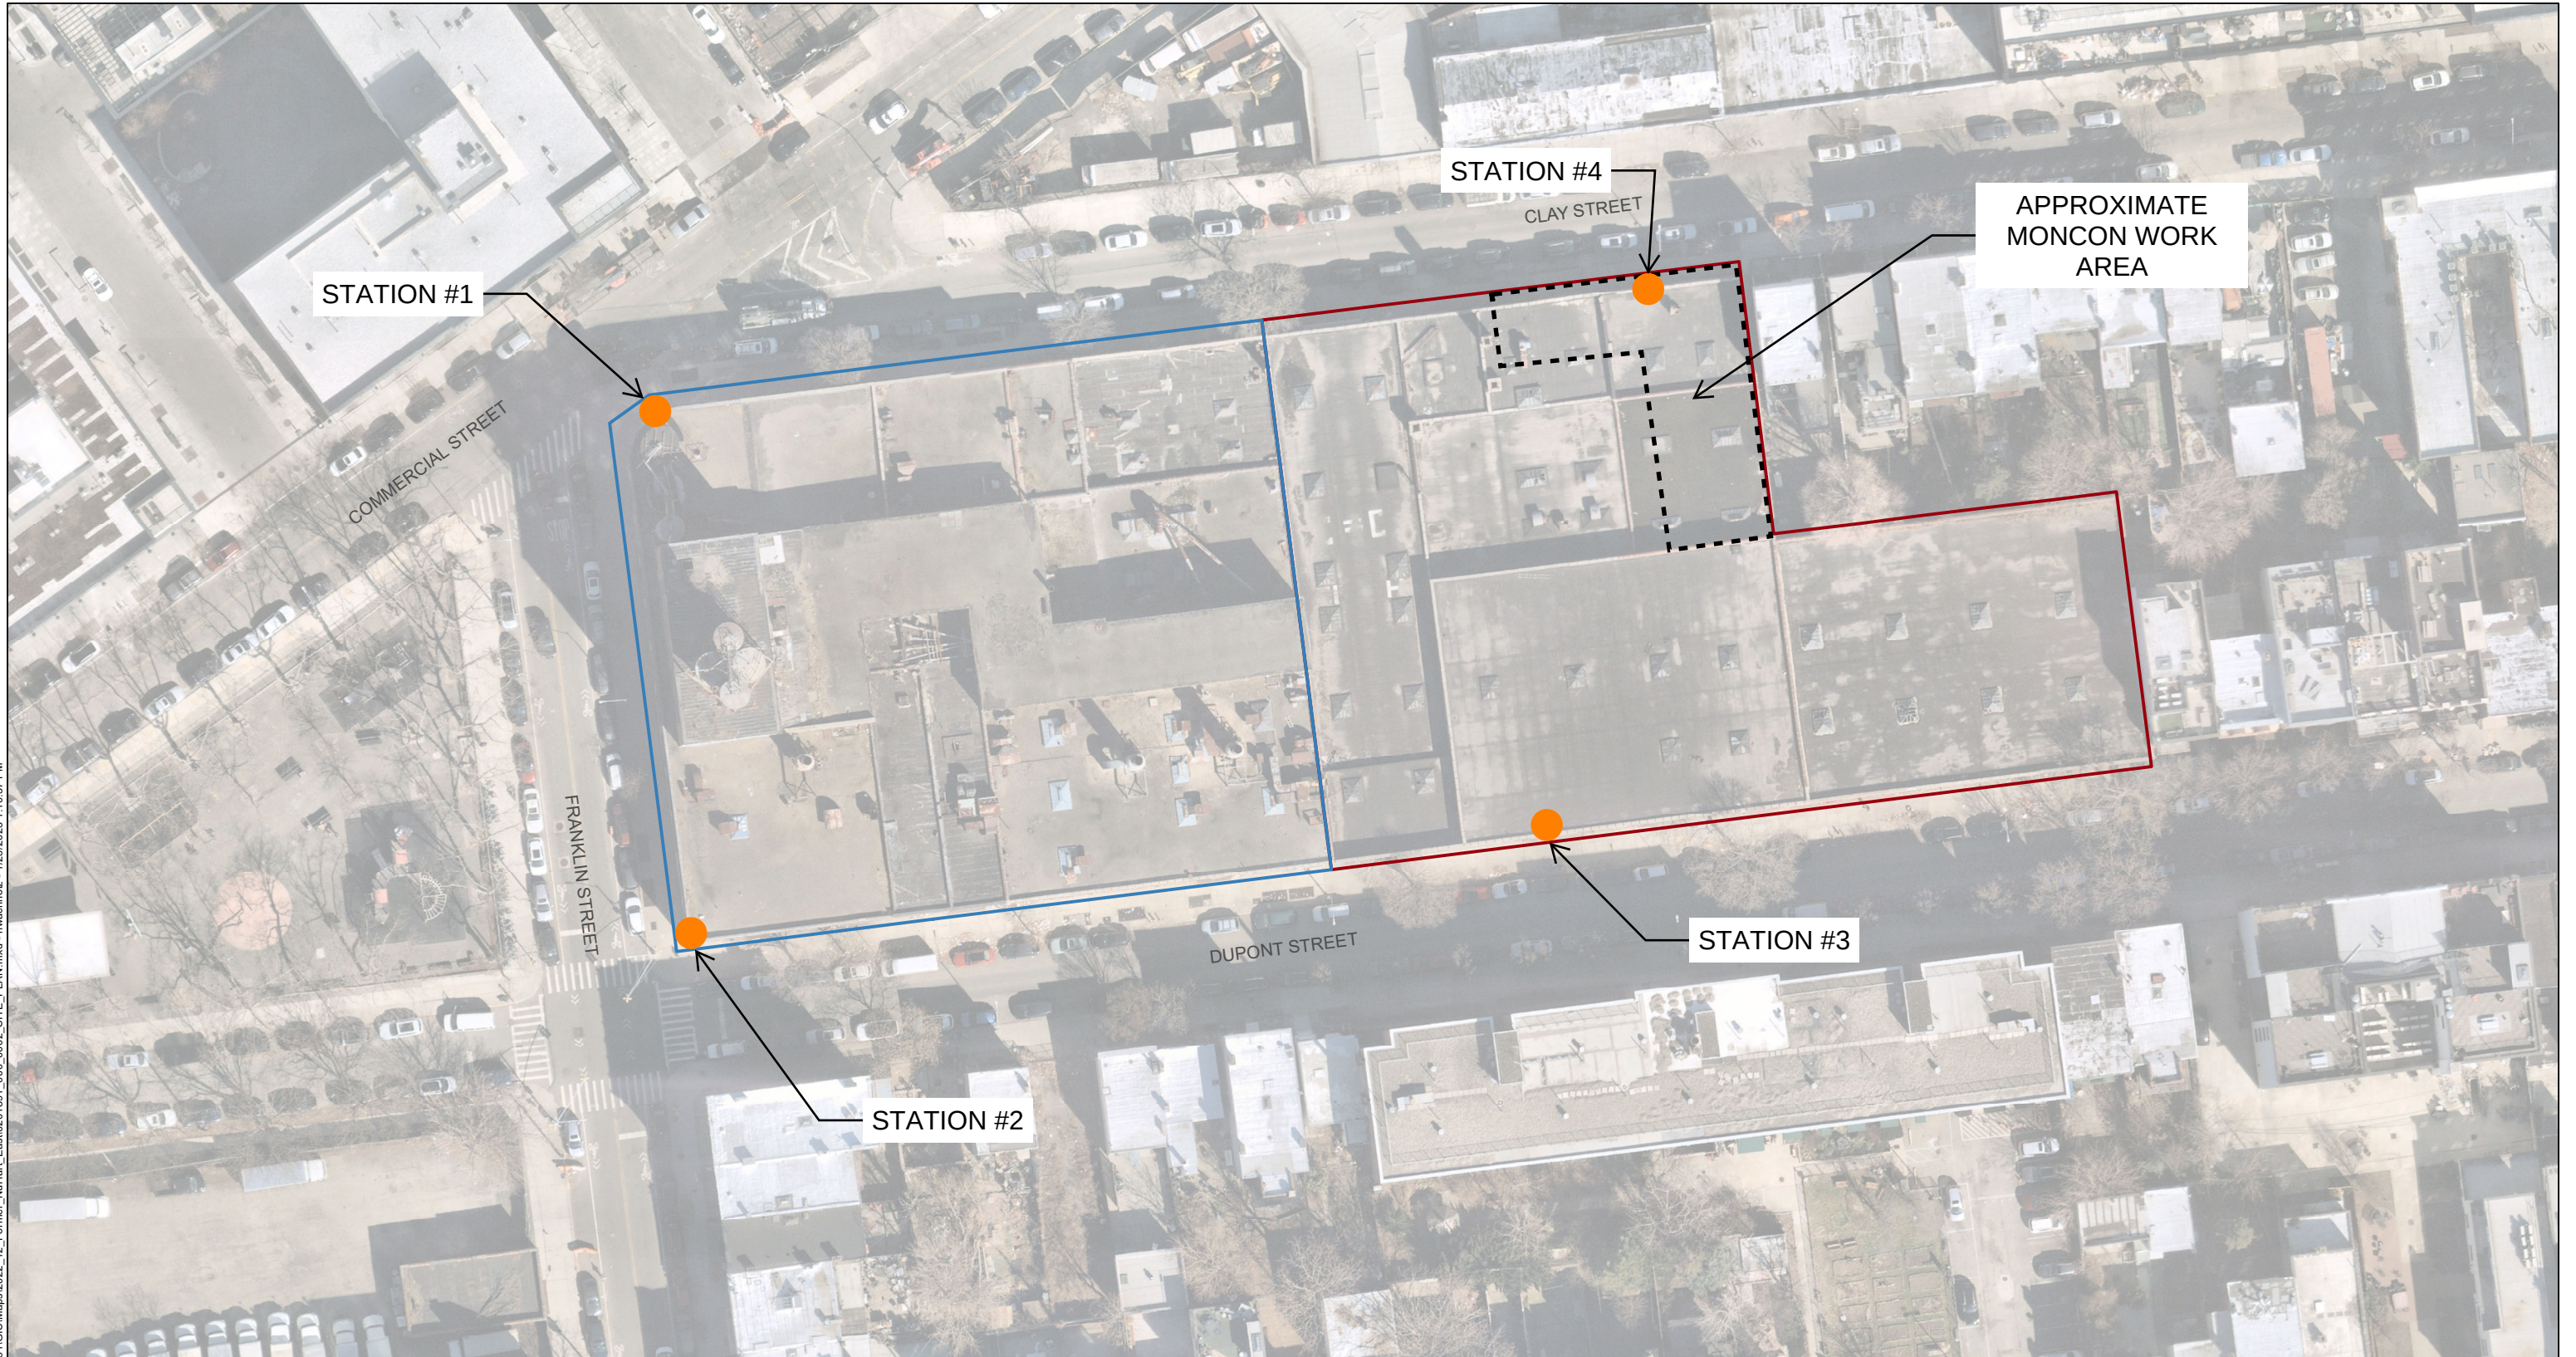


LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

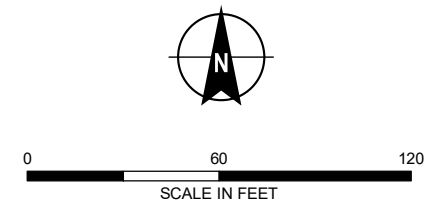

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log
On-Site (OU-1) Work Activities

Date : 2023-03-18

Personnel : P. DiNardo
Weather : 45-54°F, Sunny
Humidity : 37%
Wind Direction : W to E

Particulate Background (mg/m³) : 0.008
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
09:00	0.008	0.008	0.014	0.024	0.0	0.0	0.0	0.0		
09:15	0.007	0.007	0.006	0.020	0.0	0.0	0.0	0.0		
09:30	0.006	0.008	0.005	0.018	0.0	0.0	0.0	0.0		
09:45	0.006	0.008	0.006	0.018	0.0	0.0	0.0	0.0		
10:00	0.006	0.008	0.005	0.018	0.0	0.0	0.0	0.0		
10:15	0.008	0.008	0.005	0.019	0.0	0.0	0.0	0.0		
10:30	0.006	0.008	0.004	0.020	0.0	0.0	0.0	0.0		
10:45	0.007	0.008	0.005	0.021	0.0	0.0	0.0	0.0		
11:00	0.006	0.008	0.004	0.021	0.0	0.0	0.0	0.0		
11:15	0.006	0.008	0.005	0.020	0.0	0.0	0.0	0.0		
11:30	0.006	0.008	0.005	0.020	0.0	0.0	0.0	0.0		
11:45	0.006	0.008	0.005	0.019	0.0	0.0	0.0	0.0		
12:00	0.005	0.008	0.005	0.020	0.0	0.0	0.0	0.0		
12:15	0.006	0.008	0.005	0.020	0.0	0.0	0.0	0.0		
12:30	0.007	0.018	0.006	0.019	0.0	0.0	0.0	0.0		
12:45	0.006	0.008	0.007	0.019	0.0	0.0	0.0	0.0		
13:00	0.006	0.008	0.005	0.020	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.006	0.008	0.005	0.019	0.0	0.0	0.0	0.0		
13:30	0.005	0.008	0.005	0.018	0.0	0.0	0.0	0.0		
13:45	0.006	0.008	0.005	0.019	0.0	0.0	0.0	0.0		
14:00	0.006	0.008	0.005	0.019	0.0	0.0	0.0	0.0		
14:15	0.006	0.008	0.005	0.018	0.0	0.0	0.0	0.0		
14:30	0.006	0.008	0.005	0.021	0.0	0.0	0.0	0.0		
14:45	0.006	0.008	0.005	0.019	0.0	0.0	0.0	0.0		
15:00	0.005	0.008	0.005	0.018	0.0	0.0	0.0	0.0		
15:15	0.006	0.008	0.005	0.025	0.0	0.0	0.0	0.0		
15:30	0.006	0.008	0.006	0.019	0.0	0.0	0.0	0.0		
15:45	0.006	0.008	0.005	0.021	0.0	0.0	0.0	0.0		
16:00	0.006	0.008	0.005	0.019	0.0	0.0	0.0	0.0		
16:15	0.006	0.008	0.005	0.018	0.0	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	153
NYSDEC Site	NYSDEC Site 224136	Date	3/20/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	29-51°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering,	Wind Direction	From SW to NE up to 6 mph
Weather	Sunny	Personnel on Site	A. Stewart
Humidity	62%	Time on Site	7:00am to 5:30pm

Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 13.72 ft and water detected at 13.74 ft. Approximately 0.82 gallons of LNAPL recovered to date. No LNAPL detected in monitoring wells MW-45, MW-46, and MW-47.
- Contractor preparing to continue sheet pile installation at OU-1.
- Contractor preparing to restore sidewalk at OU-2.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ													Totals:
Today:	0 load	0 tons												
Total:	11 loads	132 tons												

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:15 am to 5:15 pm. No intrusive work performed at OU-2. An equipment malfunction occurred at Station 3 at 11:45 am. Visual and olfactory monitoring was conducted at this location during this time and no visible dust was observed. The issue was resolved by 12:15 pm. No 15-

minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.

Activities Planned for Coming Week:

- Demobilize and restore sidewalk in OU-2 work area.
- Continue installation of SOE and soil mix wall.

Site Photographs:

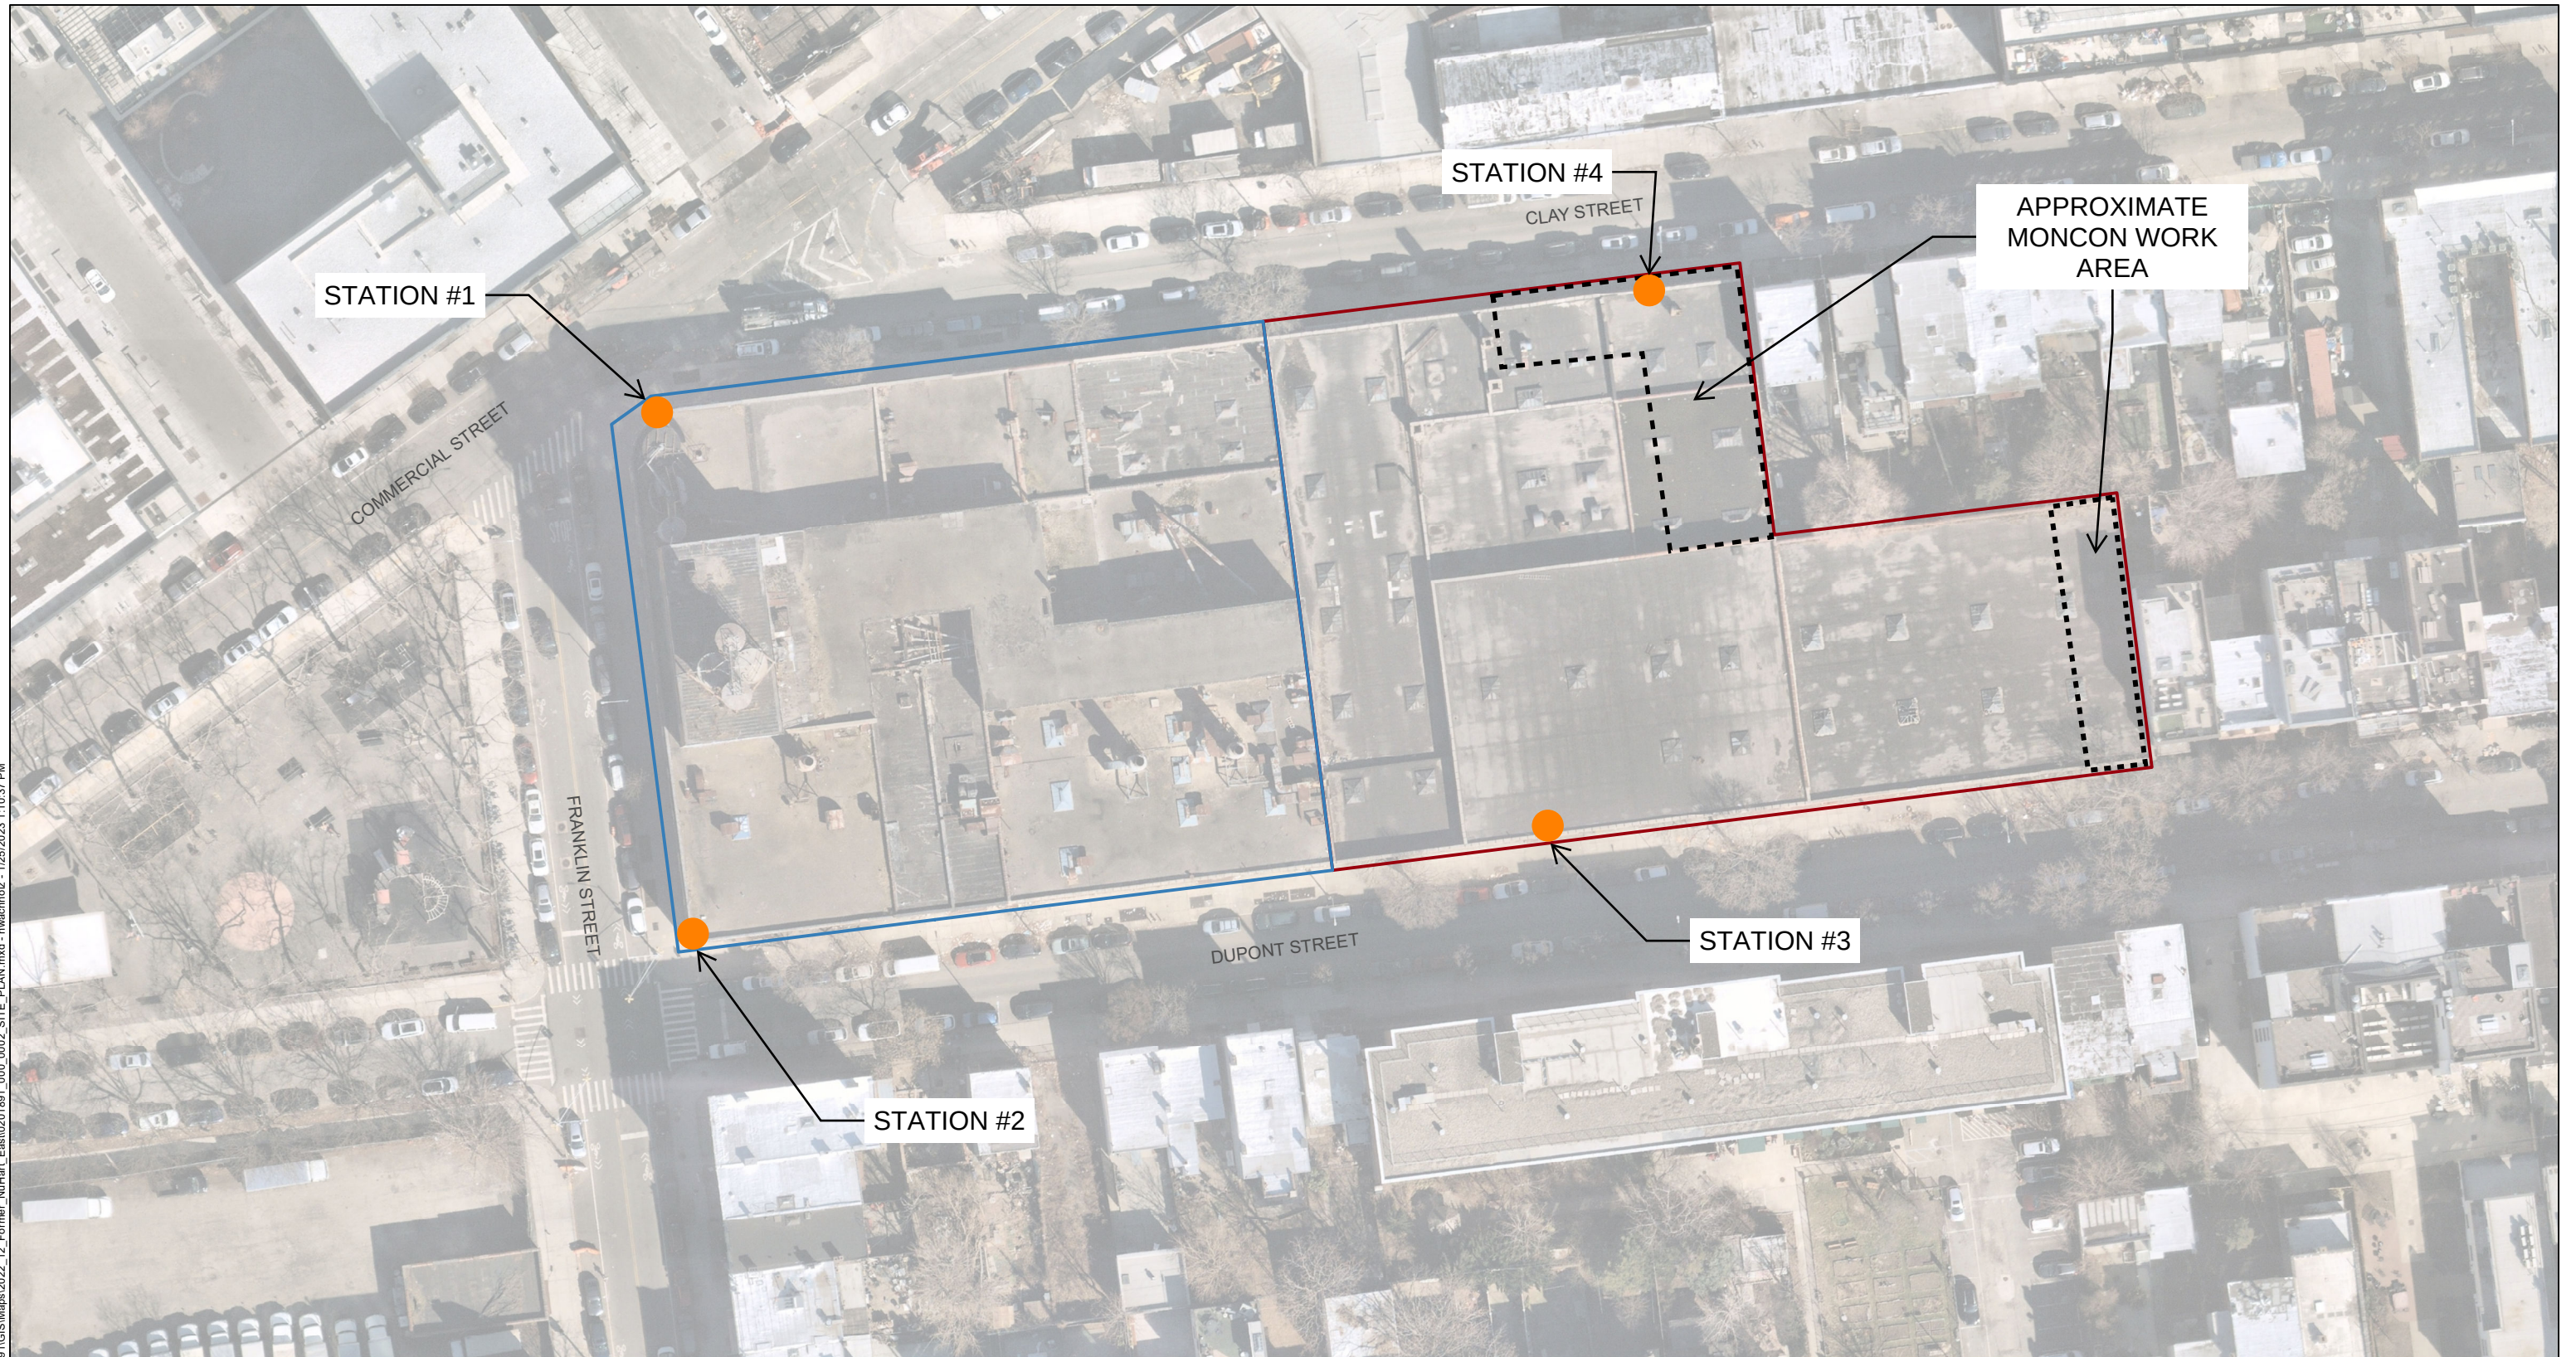


Photo 1: View of OU-2 work area facing south.



Photo 2: View of OU-2 work area facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwaichob - 1/25/2023 1:10:37 PM



LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log
On-Site (OU-1) Work Activities

Date : 2023-03-20

Personnel : A. Stewart
Weather : 29-51°F, Sunny
Humidity : 62%
Wind Direction : SW to NE

Particulate Background (mg/m³) : 0.011
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:15	0.027	0.011	0.028		0.0	0.0	0.0			
07:30	0.015	0.009	0.010		0.0	0.0	0.0			
07:45	0.011	0.010	0.008	0.294	0.0	0.0	0.0	0.0		
08:00	0.010	0.009	0.007	0.071	0.0	0.0	0.0	0.0		
08:15	0.009	0.009	0.007	0.033	0.0	0.0	0.0	0.0		
08:30	0.009	0.010	0.007	0.028	0.0	0.0	0.0	0.0		
08:45	0.009	0.010	0.008	0.026	0.0	0.0	0.0	0.0		
09:00	0.009	0.010	0.009	0.025	0.0	0.0	0.0	0.0		
09:15	0.009	0.010	0.008	0.025	0.0	0.0	0.0	0.0		
09:30	0.009	0.010	0.008	0.024	0.0	0.0	0.0	0.0		
09:45	0.009	0.010	0.008	0.024	0.0	0.0	0.0	0.0		
10:00	0.010	0.010	0.008	0.024	0.0	0.0	0.0	0.0		
10:15	0.010	0.010	0.009	0.025	0.0	0.0	0.0	0.0		
10:30	0.010	0.010	0.008	0.029	0.0	0.0	0.0	0.0		
10:45	0.010	0.011	0.009	0.031	0.0	0.0	0.0	0.0		
11:00	0.010	0.011	0.010	0.028	0.0	0.0	0.0	0.0		
11:15	0.010	0.011	0.010	0.027	0.0	0.0	0.0	0.0		
11:30	0.010	0.011	0.011	0.028	0.0	0.0	0.0	0.0		
11:45	0.010	0.011		0.028	0.0	0.0		0.0		
12:00	0.010	0.011		0.030	0.0	0.0		0.0		Equipment malfunction at Station 3.
12:15	0.010	0.011	0.010	0.026	0.0	0.0	0.0	0.0		Visual and olfactory monitoring
12:30	0.010	0.010	0.009	0.026	0.0	0.0	0.0	0.0		conducted at this location during this
12:45	0.010	0.010	0.011	0.026	0.0	0.0	0.0	0.0		time and no visible dust observed.
13:00	0.010	0.011	0.011	0.028	0.0	0.0	0.0	0.0		Troubleshoot with technician and
										equipment running 12:15pm.

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.010	0.010	0.011	0.028	0.0	0.0	0.0	0.0		
13:30	0.011	0.010	0.010	0.026	0.0	0.0	0.0	0.0		
13:45	0.010	0.010	0.009	0.025	0.0	0.0	0.0	0.0		
14:00	0.009	0.010	0.009	0.025	0.0	0.0	0.0	0.0		
14:15	0.011	0.011	0.012	0.027	0.0	0.0	0.0	0.0		
14:30	0.010	0.010	0.010	0.028	0.0	0.0	0.0	0.0		
14:45	0.010	0.010	0.009	0.025	0.0	0.0	0.0	0.0		
15:00	0.010	0.010	0.009	0.031	0.0	0.0	0.0	0.0		
15:15	0.010	0.010	0.011	0.038	0.0	0.0	0.0	0.0		
15:30	0.011	0.011	0.010	0.028	0.0	0.0	0.0	0.0		
15:45	0.012	0.011	0.012	0.026	0.0	0.0	0.0	0.0		
16:00	0.014	0.011	0.015	0.028	0.0	0.0	0.0	0.0		
16:15	0.012	0.011	0.011	0.028	0.0	0.0	0.0	0.0		
16:30	0.012	0.011	0.012	0.027	0.0	0.0	0.0	0.0		
16:45	0.014	0.012	0.013	0.028	0.0	0.0	0.0	0.0		
17:00	0.013	0.011	0.015	0.027	0.0	0.0	0.0	0.0		
17:15	0.012	0.011	0.011	0.028	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 13.76 ft and water detected at 13.79 ft. Approximately 0.82 gallons of LNAPL recovered to date.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Material Export:

- | | | | | | | | | |
|--------|--------------------------------|-------------|--|--|--|--|--|---------|
| | Clean Earth of
Carteret, NJ | | | | | | | Totals: |
| Today: | 0
load | 0
tons | | | | | | |
| Total: | 11
loads | 132
tons | | | | | | |

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

- None

- None

Community air monitoring was performed at one upwind and two downwind locations on-site from 7:15 am to 3:30 pm. No intrusive work conducted in OU-2. An equipment malfunction occurred at Station #3 at 8:15 am, the issue was resolved with the technician and the station was running by 8:30am. Visual and olfactory monitoring conducted at this location during this time, no visible dust was observed. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.


Activities Planned for Coming Week:

- Demobilize and restore sidewalk in OU-2 work area.
- Continue installation of SOE and soil mix wall in OU-1.

Site Photographs:

Photo 1: View of OU-2 work area facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwaichob - 1/25/2023 1:10:37 PM

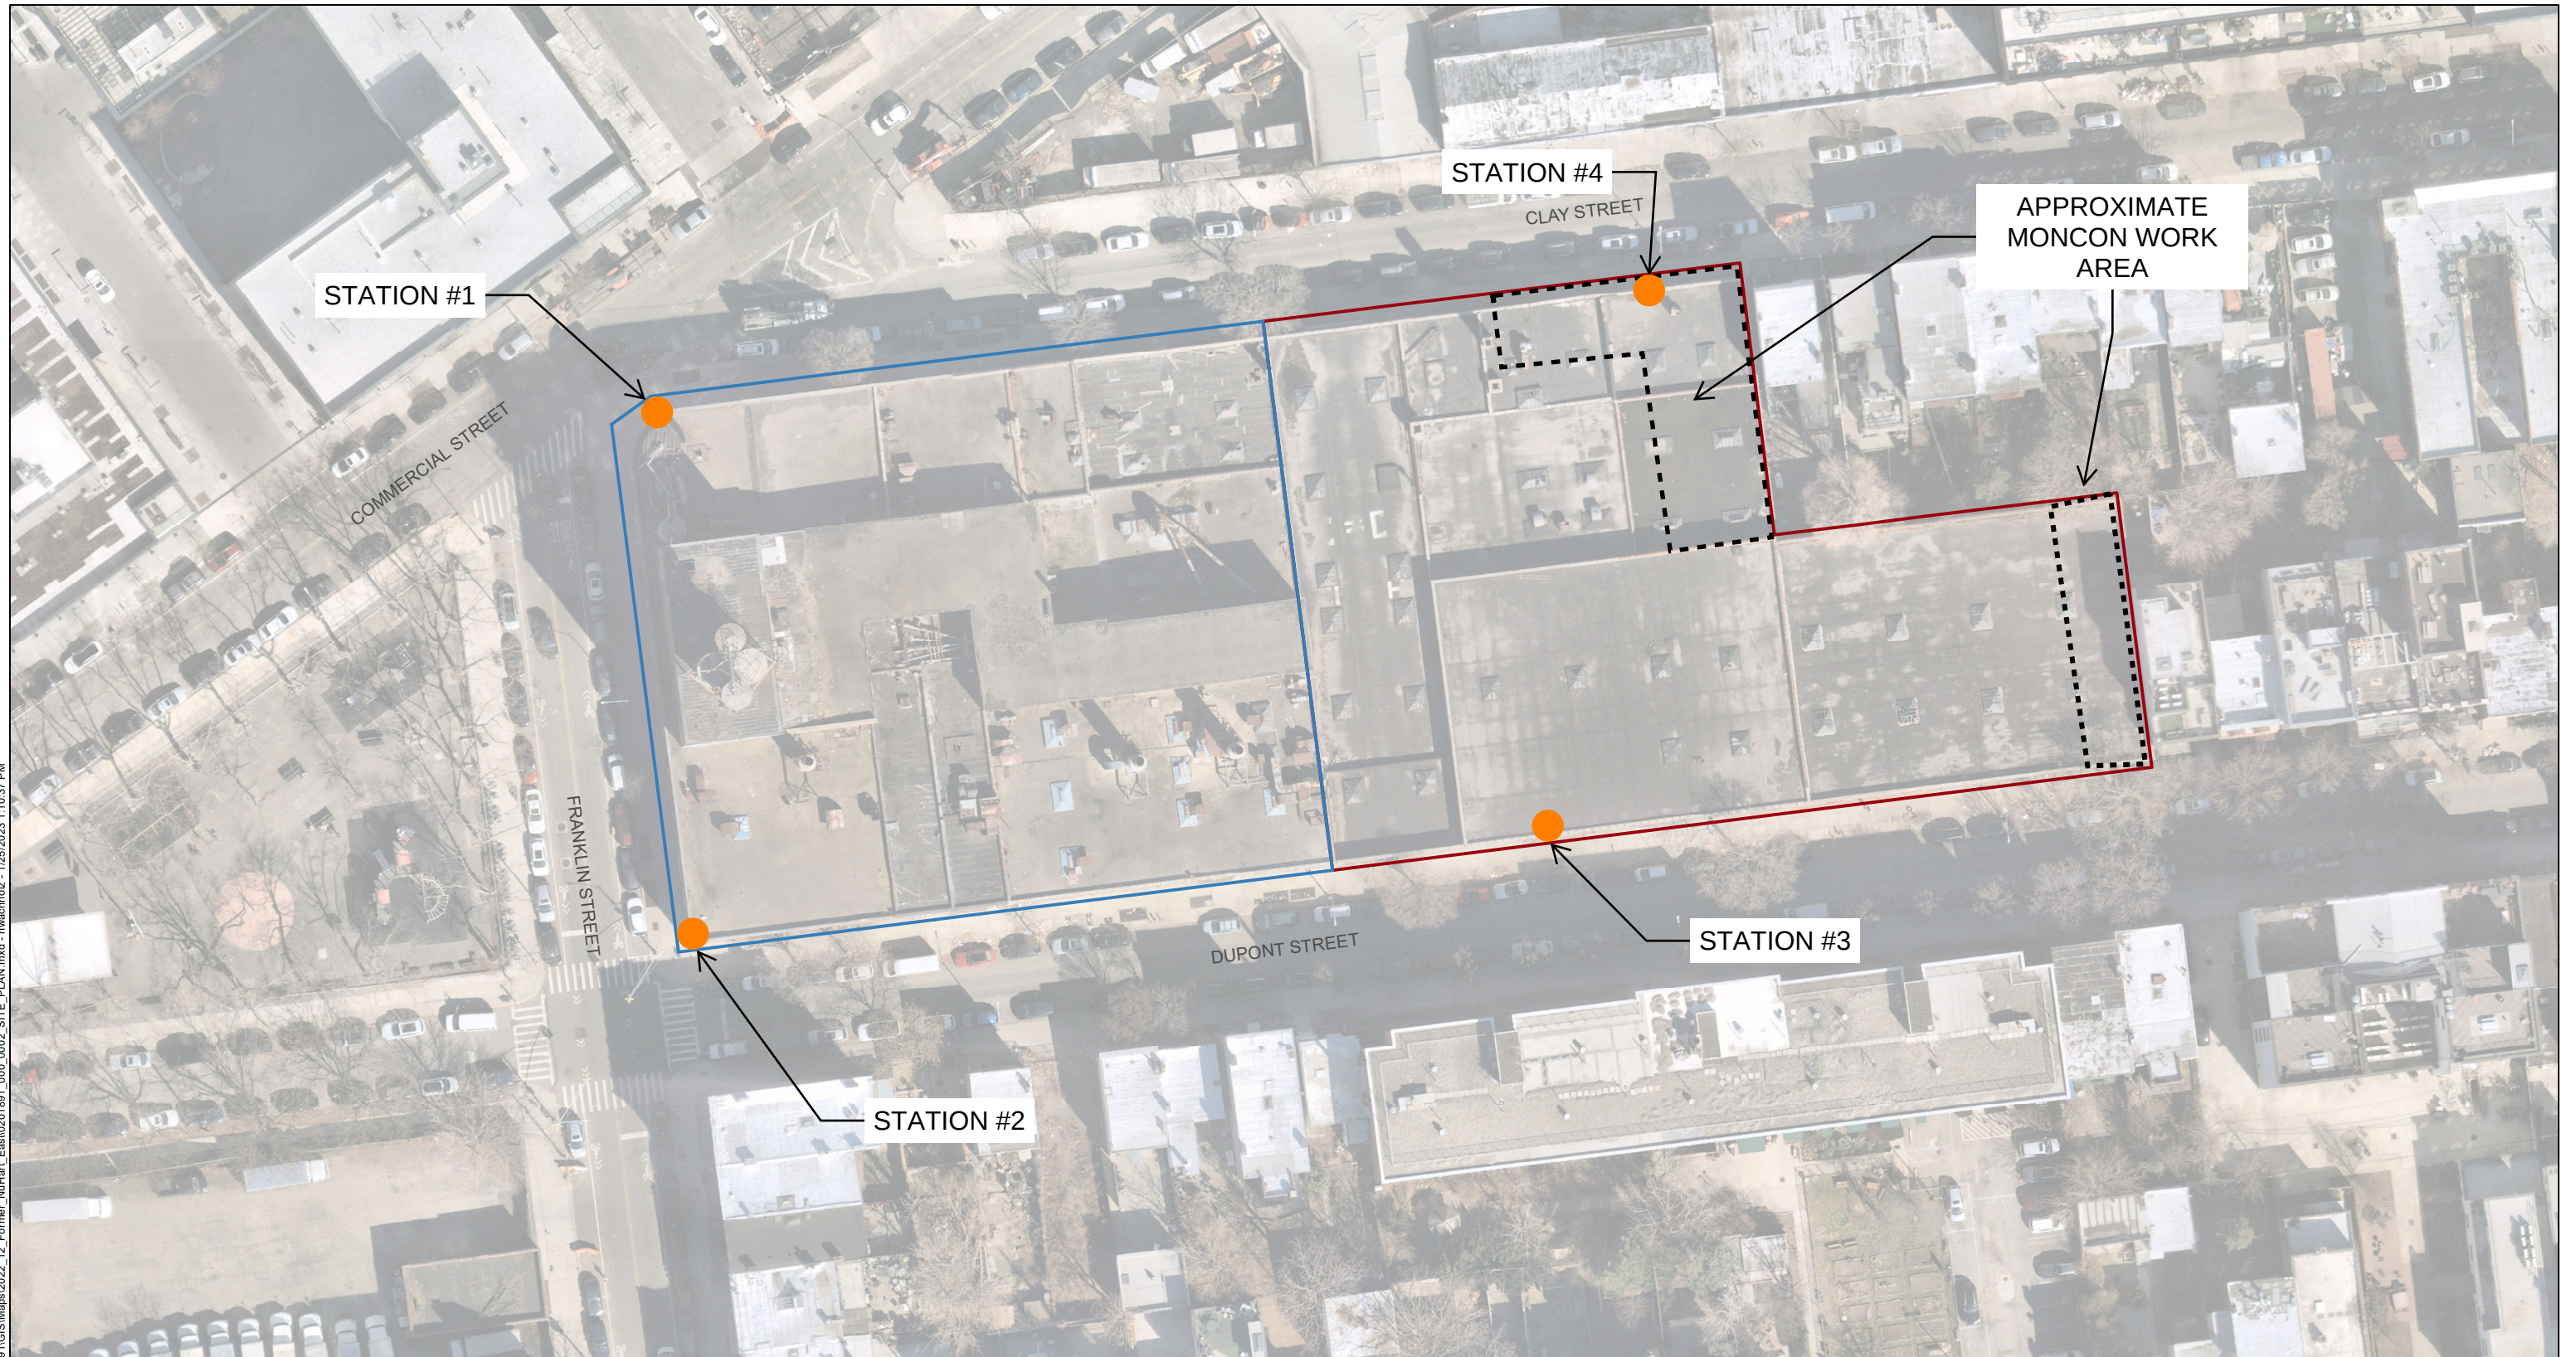


LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

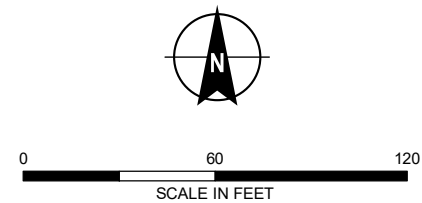

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-03-21

On-Site (OU-1) Work Activities

Personnel : A. Stewart
 Weather : 36 to 60°F, Sunny
 Humidity : 56%
 Wind Direction : W to E

Particulate Background (mg/m³) : 0.013

PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.018	0.013	0.018		0.0	0.0	0.0			
07:15	0.017	0.013	0.012	0.029	0.0	0.0	0.0	0.0		
07:30	0.013	0.011	0.012	0.028	0.0	0.0	0.0	0.0		
07:45	0.012	0.011	0.011	0.029	0.0	0.0	0.0	0.0		
08:00	0.012	0.012	0.012	0.030	0.0	0.0	0.0	0.0		
08:15	0.012		0.011	0.027	0.0		0.0	0.0		Equipment malfunction at Station #3 at 8:15am, troubleshoot issue with technician and station running by 8:30am. Visual and olfactory monitoring at this location during this time, no visible dust observed.
08:30	0.012	0.016	0.011	0.029	0.0	0.0	0.0	0.0		
08:45	0.013	0.012	0.012	0.029	0.0	0.0	0.0	0.0		
09:00	0.012	0.013	0.012	0.029	0.0	0.0	0.0	0.0		
09:15	0.013	0.012	0.011	0.033	0.0	0.0	0.0	0.0		
09:30	0.012	0.012	0.011	0.050	0.0	0.0	0.0	0.0		
09:45	0.011	0.012	0.010	0.028	0.0	0.0	0.0	0.0		
10:00	0.013	0.012	0.011	0.035	0.0	0.0	0.0	0.0		
10:15	0.011	0.012	0.014	0.029	0.0	0.0	0.0	0.0		
10:30	0.010	0.011	0.010	0.028	0.0	0.0	0.0	0.0		
10:45	0.010	0.011	0.010	0.028	0.0	0.0	0.0	0.0		
11:00	0.009	0.010	0.009	0.040	0.0	0.0	0.0	0.0		
11:15	0.008	0.009	0.008	0.033	0.0	0.0	0.0	0.0		
11:30	0.008	0.009	0.008	0.038	0.0	0.0	0.0	0.0		
11:45	0.009	0.010	0.009	0.034	0.0	0.0	0.0	0.0		
12:00	0.009	0.010	0.010	0.025	0.0	0.0	0.0	0.0		
12:15	0.010	0.010	0.010	0.026	0.0	0.0	0.0	0.0		
12:30	0.009	0.010	0.010	0.025	0.0	0.0	0.0	0.0		
12:45	0.009	0.010	0.010	0.024	0.0	0.0	0.0	0.0		
13:00	0.009	0.009	0.010	0.026	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.009	0.010	0.010	0.025	0.0	0.0	0.0	0.0		
13:30	0.008	0.010	0.013	0.032	0.0	0.0	0.0	0.0		
13:45	0.008	0.010	0.013	0.033	0.0	0.0	0.0	0.0		
14:00	0.008	0.010	0.009	0.030	0.0	0.0	0.0	0.0		
14:15	0.008	0.010	0.009	0.024	0.0	0.0	0.0	0.0		
14:30	0.008	0.010	0.009	0.026	0.0	0.0	0.0	0.0		
14:45	0.009	0.010	0.010	0.026	0.0	0.0	0.0	0.0		
15:00	0.007	0.010	0.009	0.036	0.0	0.0	0.0	0.0		
15:15	0.008	0.010	0.008	0.025	0.0	0.0	0.0	0.0		
15:30	0.007	0.009	0.008	0.023	0.0	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	155
NYSDEC Site	NYSDEC Site 224136	Date	3/22/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	42-58°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering,	Wind Direction	From SW to NE up to 5 mph
Weather	Cloudy	Personnel on Site	A. Stewart
Humidity	52%	Time on Site	7:00am to 6:15pm

Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 13.75 ft and water detected at 13.78 ft. Approximately 0.83 gallons of LNAPL recovered to date. No LNAPL detected in monitoring wells MW-45, MW-46, and MW-47.
- Contractor poured concrete to restore sidewalk in OU-2.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ												Totals:
Today:	0 load	0 tons											
Total:	<u>10</u> loads	<u>120</u> tons											

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations on-site from 7:15 am to 5:45 pm. No intrusive work conducted in OU-2. Equipment malfunction at Station #3 at 8:30am, troubleshoot issue with technician and station running by 8:45am. Visual and olfactory monitoring at this location during this time, no visible dust observed. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.

Activities Planned for Coming Week:

- Demobilize and restore sidewalk in OU-2 work area.
- Continue installation of SOE and soil mix wall in OU-1.


Site Photographs:

Photo 1: View of concrete pour at OU-2 work area facing east.



Photo 2: Alternate view of concrete pour at OU-2 work area facing south.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Map\2022_12_Former_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwalcholz - 1/25/2023 1:10:37 PM

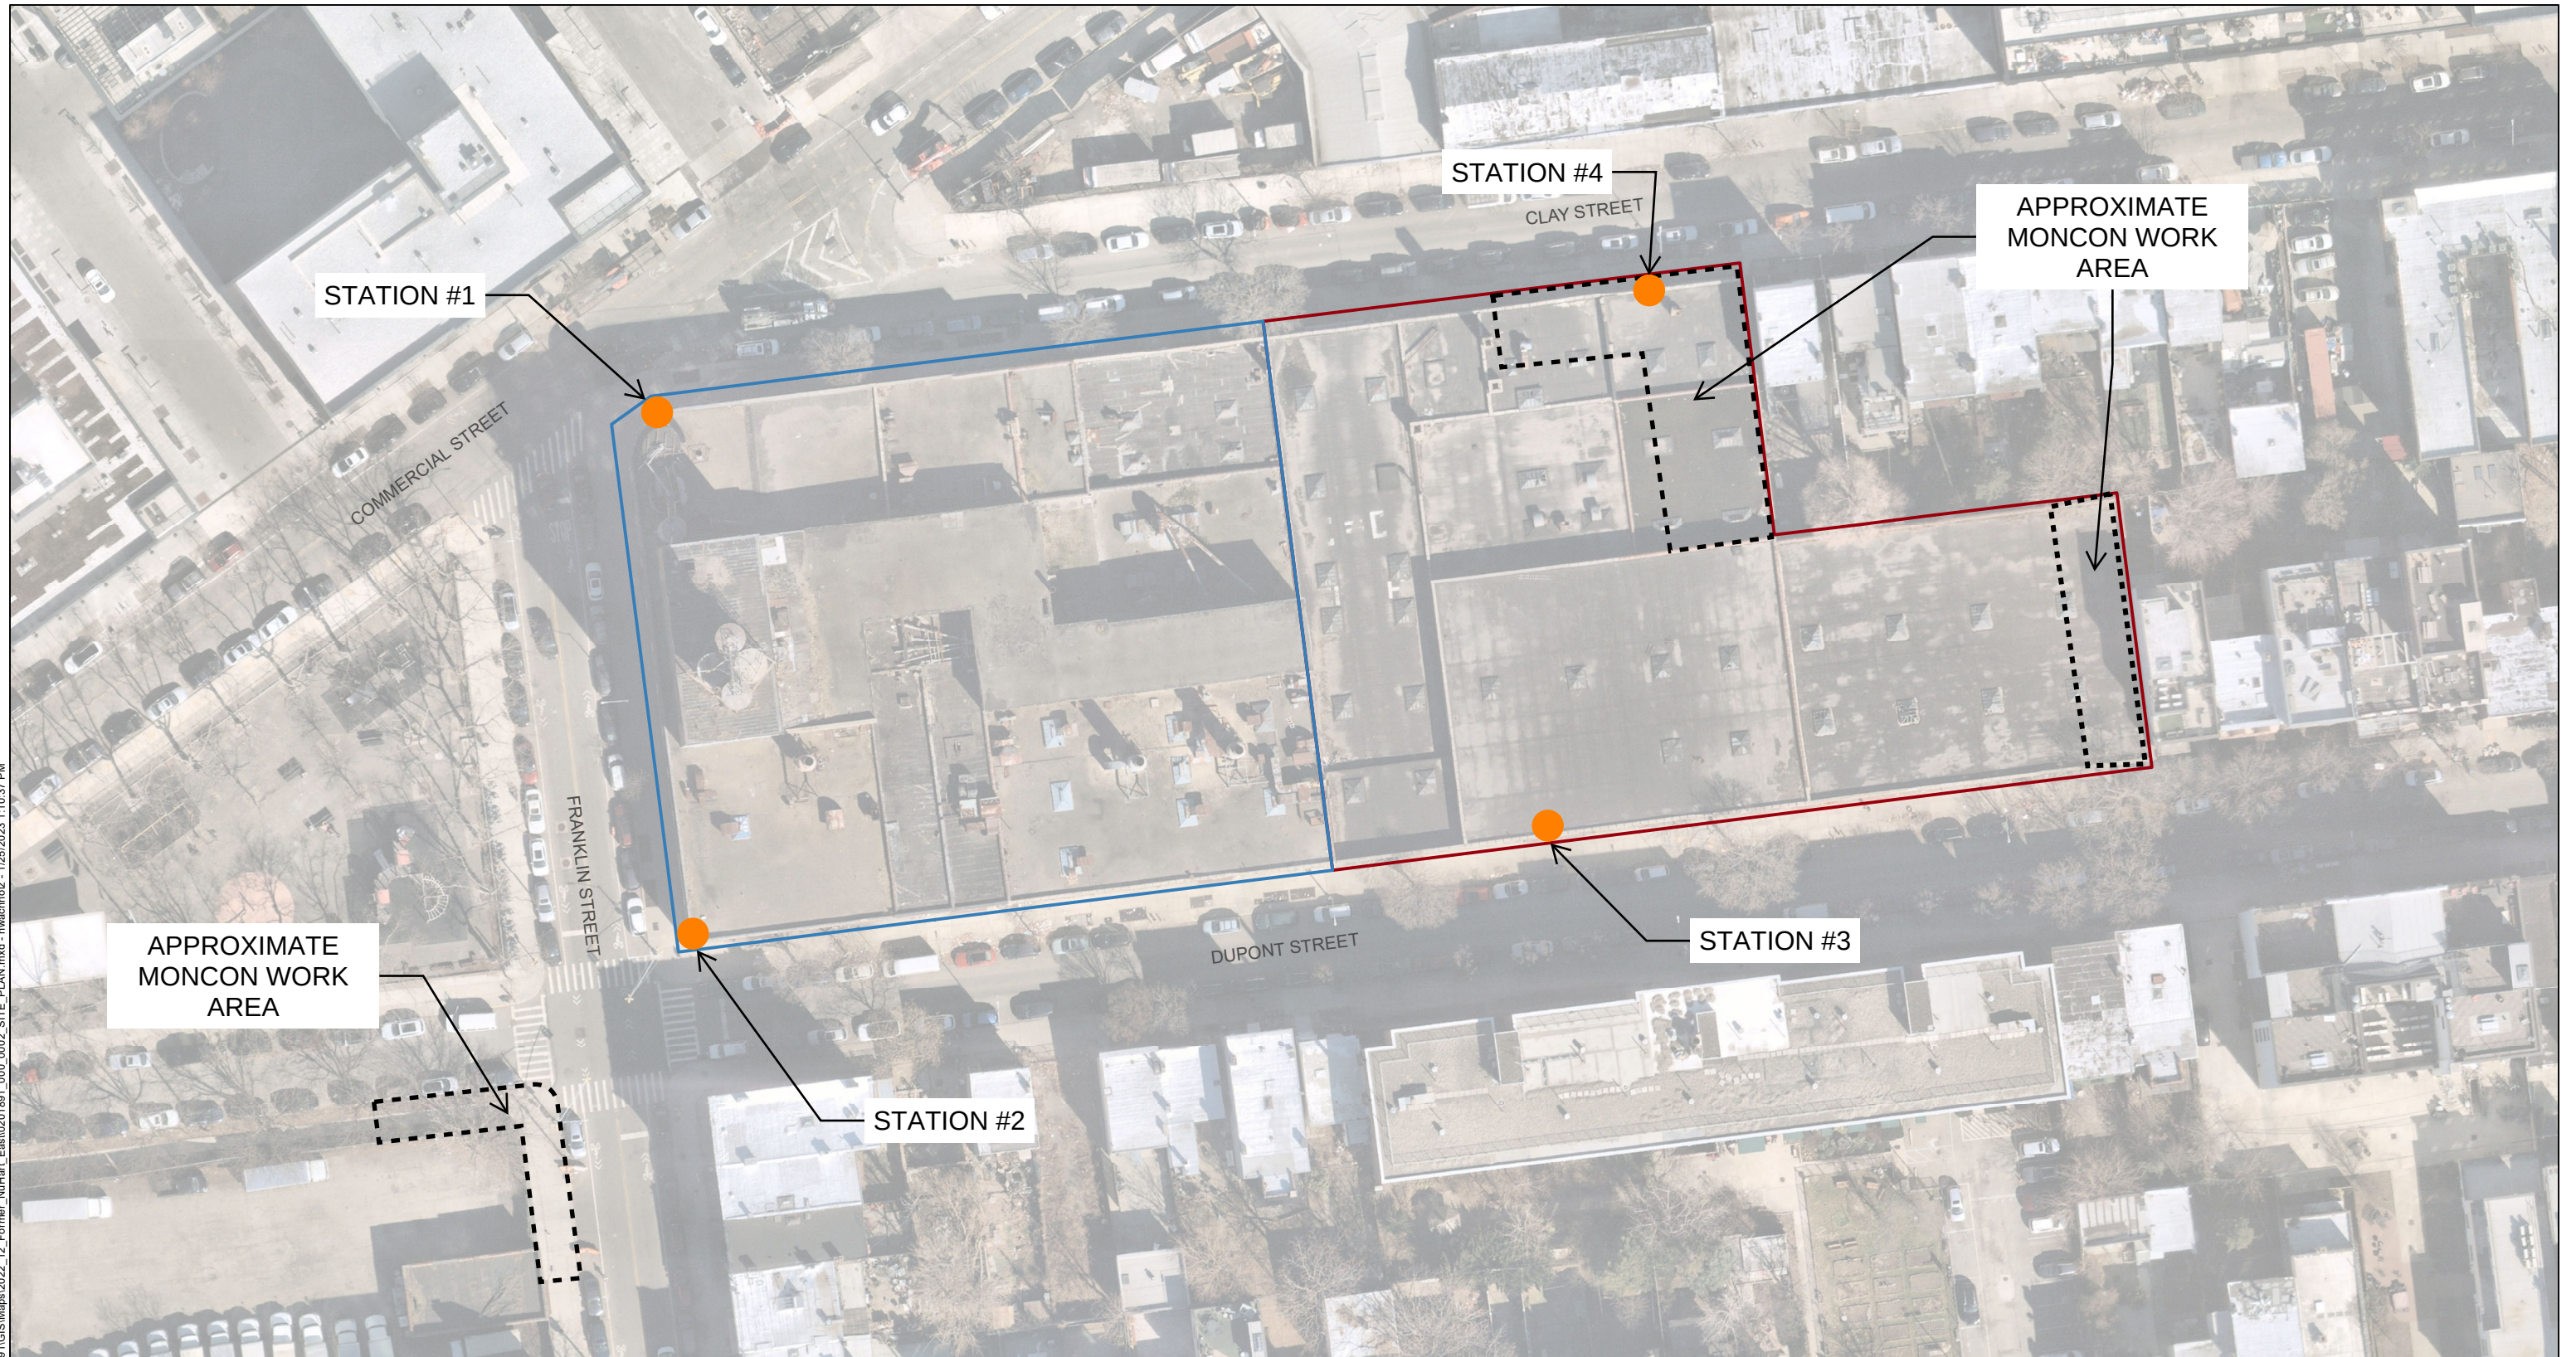


LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

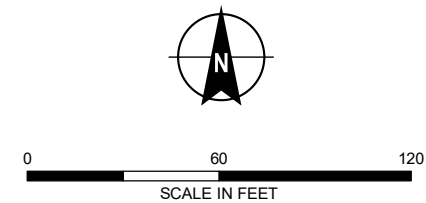

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-03-22

On-Site (OU-1) Work Activities

Personnel : A. Stewart

Weather : 42 to 58°F, Cloudy

Humidity : 52%

Wind Direction : SW to NE

Particulate Background (mg/m³) : 0.010

PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.028	0.010			0.0	0.0				
07:15	0.019	0.016	0.016	0.035	0.0	0.0	0.0	0.0		
07:30	0.014	0.010	0.011	0.034	0.0	0.0	0.0	0.0		
07:45	0.011	0.010	0.009	0.043	0.0	0.0	0.0	0.2		
08:00	0.011	0.010	0.012	0.033	0.0	0.0	0.0	0.2		
08:15	0.010	0.010	0.019	0.034	0.0	0.0	0.0	0.2		
08:30	0.011	0.011		0.031	0.0	0.0		0.0		Equipment malfunction at Station #3 at 8:30am, troubleshoot issue with technician and station running by 8:45am. Visual and olfactory monitoring at this location during this time, no visible dust observed.
08:45	0.011	0.011	0.011	0.036	0.0	0.0	0.0	0.0		
09:00	0.012	0.012	0.012	0.033	0.0	0.0	0.0	0.0		
09:15	0.012	0.011	0.014	0.036	0.0	0.0	0.0	0.1		
09:30	0.012	0.012	0.011	0.058	0.0	0.0	0.0	0.0		
09:45	0.011	0.011	0.013	0.029	0.0	0.0	0.0	0.0		
10:00	0.011	0.011	0.010	0.033	0.0	0.0	0.0	0.0		
10:15	0.011	0.010	0.010	0.035	0.0	0.0	0.0	0.0		
10:30	0.011	0.011	0.010	0.033	0.0	0.0	0.0	0.1		
10:45	0.010	0.010	0.011	0.033	0.0	0.0	0.0	0.1		
11:00	0.013	0.010	0.012	0.032	0.0	0.0	0.0	0.0		
11:15	0.012	0.011	0.011	0.028	0.0	0.0	0.0	0.0		
11:30	0.010	0.010	0.010	0.029	0.0	0.0	0.0	0.0		
11:45	0.010	0.011	0.010	0.034	0.0	0.0	0.0	0.1		
12:00	0.010	0.010	0.010	0.026	0.0	0.0	0.0	0.0		
12:15	0.009	0.010	0.009	0.027	0.0	0.0	0.0	0.0		
12:30	0.010	0.010	0.010	0.029	0.0	0.0	0.0	0.0		
12:45	0.010	0.011	0.010	0.027	0.0	0.0	0.0	0.2		
13:00	0.011	0.011	0.010	0.027	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.012	0.010	0.014	0.028	0.0	0.0	0.0	0.0		
13:30	0.011	0.011	0.011	0.026	0.0	0.0	0.0	0.0		
13:45	0.011	0.012	0.011	0.027	0.0	0.0	0.0	0.0		
14:00	0.011	0.011	0.011	0.027	0.0	0.0	0.0	0.0		
14:15	0.010	0.011	0.010	0.026	0.0	0.0	0.0	0.0		
14:30	0.011	0.011	0.010	0.026	0.0	0.0	0.0	0.0		
14:45	0.011	0.010	0.011	0.027	0.0	0.0	0.0	0.0		
15:00	0.008	0.009	0.008	0.025	0.0	0.0	0.0	0.0		
15:15	0.008	0.010	0.007	0.024	0.0	0.0	0.0	0.0		
15:30	0.008	0.009	0.007	0.026	0.0	0.0	0.0	0.0		
15:45	0.010	0.009	0.007	0.027	0.0	0.0	0.0	0.0		
16:00	0.011	0.009	0.008	0.029	0.0	0.0	0.0	0.0		
16:15	0.011	0.009	0.008	0.029	0.0	0.0	0.0	0.0		
16:30	0.012	0.009	0.007	0.029	0.0	0.0	0.0	0.0		
16:45	0.012	0.010	0.008	0.026	0.0	0.0	0.0	0.0		
17:00	0.011	0.009	0.008	0.027	0.0	0.0	0.0	0.0		
17:15	0.011	0.009	0.008	0.028	0.0	0.0	0.0	0.0		
17:30	0.011	0.009	0.008	0.028	0.0	0.0	0.0	0.0		
17:45	0.011	0.009	0.007	0.029	0.0	0.0	0.0	0.0		
18:00			0.007				0.0			

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	156
NYSDEC Site	NYSDEC Site 224136	Date	3/23/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	46-62°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering,	Wind Direction	From SW to NE up to 7 mph
Weather	Cloudy	Personnel on Site	A. Stewart
Humidity	78%	Time on Site	7:00am to 5:00pm

Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 13.81 ft and water detected at 13.84 ft. Approximately 0.83 gallons of LNAPL recovered to date. No LNAPL detected in monitoring wells MW-45, MW-46, and MW-47.
- Contractor removed fence barriers surrounding restored OU-2 sidewalk area.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ												Totals:
Today:	0 load	0 tons											
Total:	<u>13</u> loads	<u>156</u> tons											

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations on-site from 7:30am to 4:40pm. No intrusive work conducted in OU-2. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.


Activities Planned for Coming Week:

- Demobilize and restore sidewalk in OU-2 work area.
- Continue installation of SOE and soil mix wall in OU-1.

Site Photograph:

Photo 1: View of OU-2 work area restoration facing south.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwalcholz - 1/25/2023 1:10:37 PM

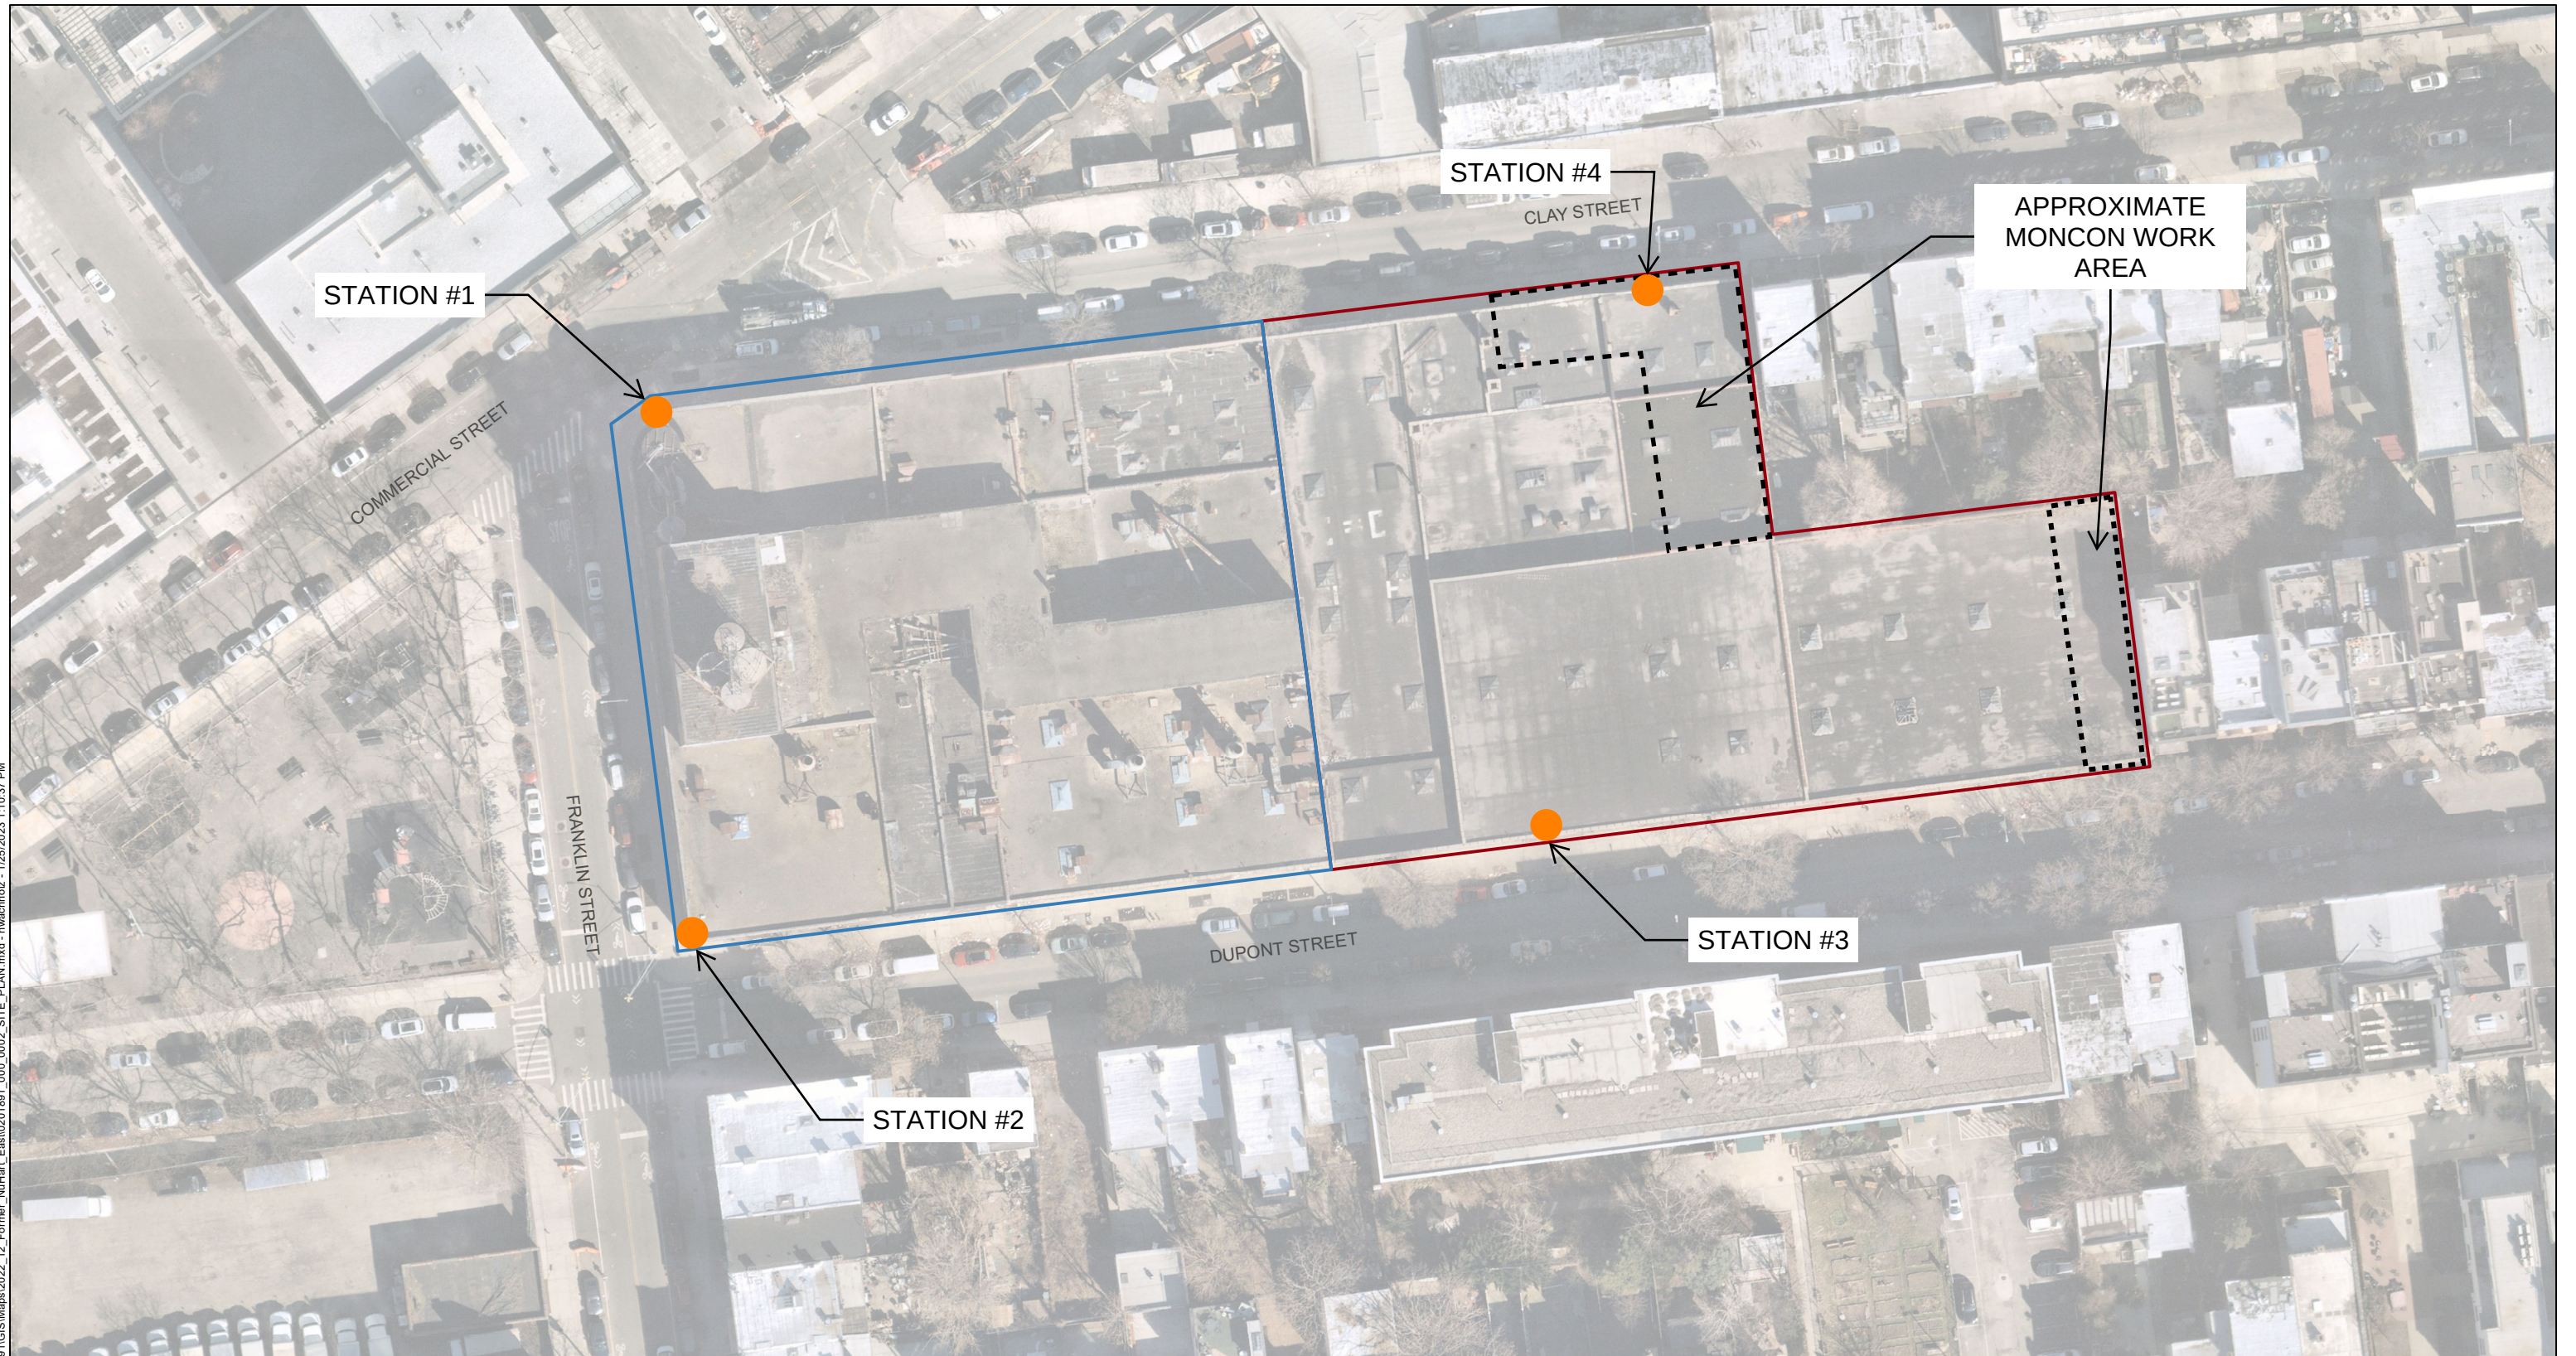


LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-03-23

On-Site (OU-1) Work Activities

Personnel : A. StewartWeather : 42 to 62°F, CloudyHumidity : 78%Wind Direction : SW to NEParticulate Background (mg/m³) : 0.017PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:15		0.017	0.023			0.0	0.0			
07:30	0.016	0.014	0.014	0.035	0.0	0.0	0.0	0.0		
07:45	0.014	0.013	0.013	0.032	0.0	0.0	0.0	0.0		
08:00	0.016	0.014	0.015	0.036	0.0	0.0	0.0	0.0		
08:15	0.015	0.013	0.013	0.033	0.0	0.0	0.0	0.0		
08:30	0.015	0.013	0.013	0.032	0.0	0.0	0.0	0.0		
08:45	0.015	0.013	0.013	0.034	0.0	0.0	0.0	0.0		
09:00	0.015	0.017	0.013	0.031	0.0	0.0	0.0	0.0		
09:15	0.014	0.012	0.012	0.031	0.0	0.0	0.0	0.0		
09:30	0.014	0.012	0.013	0.034	0.0	0.0	0.0	0.0		
09:45	0.015	0.012	0.014	0.032	0.0	0.0	0.0	0.0		
10:00	0.016	0.013	0.015	0.034	0.0	0.0	0.0	0.0		
10:15	0.017	0.015	0.015	0.033	0.0	0.0	0.0	0.0		
10:30	0.017	0.014	0.025	0.036	0.0	0.0	0.0	0.0		
10:45	0.017	0.014	0.015	0.037	0.0	0.0	0.0	0.0		
11:00	0.017	0.014	0.015	0.037	0.0	0.0	0.0	0.0		
11:15	0.017	0.014	0.016	0.035	0.0	0.0	0.0	0.0		
11:30	0.017	0.014	0.016	0.037	0.0	0.0	0.0	0.0		
11:45	0.015	0.013	0.015	0.036	0.0	0.0	0.0	0.0		
12:00	0.016	0.014	0.016	0.035	0.0	0.0	0.0	0.0		
12:15	0.017	0.014	0.016	0.037	0.0	0.0	0.0	0.0		
12:30	0.017	0.014	0.017	0.034	0.0	0.0	0.0	0.0		
12:45	0.018	0.015	0.017	0.034	0.0	0.0	0.0	0.0		
13:00	0.018	0.015	0.018	0.034	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.018	0.015	0.017	0.035	0.0	0.0	0.0	0.0		
13:30	0.018	0.015	0.017	0.035	0.0	0.0	0.0	0.0		
13:45	0.018	0.015	0.017	0.034	0.0	0.0	0.0	0.0		
14:00	0.018	0.015	0.017	0.035	0.0	0.0	0.0	0.0		
14:15	0.019	0.015	0.018	0.035	0.0	0.0	0.0	0.0		
14:30	0.019	0.015	0.018	0.035	0.0	0.0	0.0	0.0		
14:45	0.019	0.015	0.018	0.035	0.0	0.0	0.0	0.0		
15:00	0.020	0.015	0.018	0.036	0.0	0.0	0.0	0.0		
15:15	0.020	0.016	0.019	0.036	0.0	0.0	0.0	0.0		
15:30	0.020	0.016	0.019	0.036	0.0	0.0	0.0	0.0		
15:45	0.020	0.016	0.019	0.036	0.0	0.0	0.0	0.0		
16:00	0.021	0.016	0.020	0.036	0.0	0.0	0.0	0.0		
16:15	0.021	0.016	0.020	0.036	0.0	0.0	0.0	0.0		
16:30	0.020	0.016	0.019	0.036	0.0	0.0	0.0	0.0		
16:45			0.019				0.0			

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	157
NYSDEC Site	NYSDEC Site 224136	Date	3/24/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	44-57°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering,	Wind Direction	From NW to SE up to 9 mph
Weather	Cloudy / Drizzle	Personnel on Site	A. Stewart
Humidity	58%	Time on Site	7:00am to 5:15pm

Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 13.81 ft and water detected at 13.84 ft. Approximately 0.86 gallons of LNAPL recovered to date. No LNAPL detected in monitoring wells MW-45, MW-46, and MW-47.
- Contractor removed fence barriers surrounding OU-2 work area.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ												Totals:
Today:	1 load	12 tons											
Total:	14 loads	168 tons											

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations on-site from 7:30am to 5:00pm. No intrusive work conducted in OU-2. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.


Activities Planned for Coming Week:

- Continue installation of SOE and soil mix wall in OU-1.

Site Photographs:

Photo 1: View of OU-2 work area facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwalcholz - 1/25/2023 1:10:37 PM

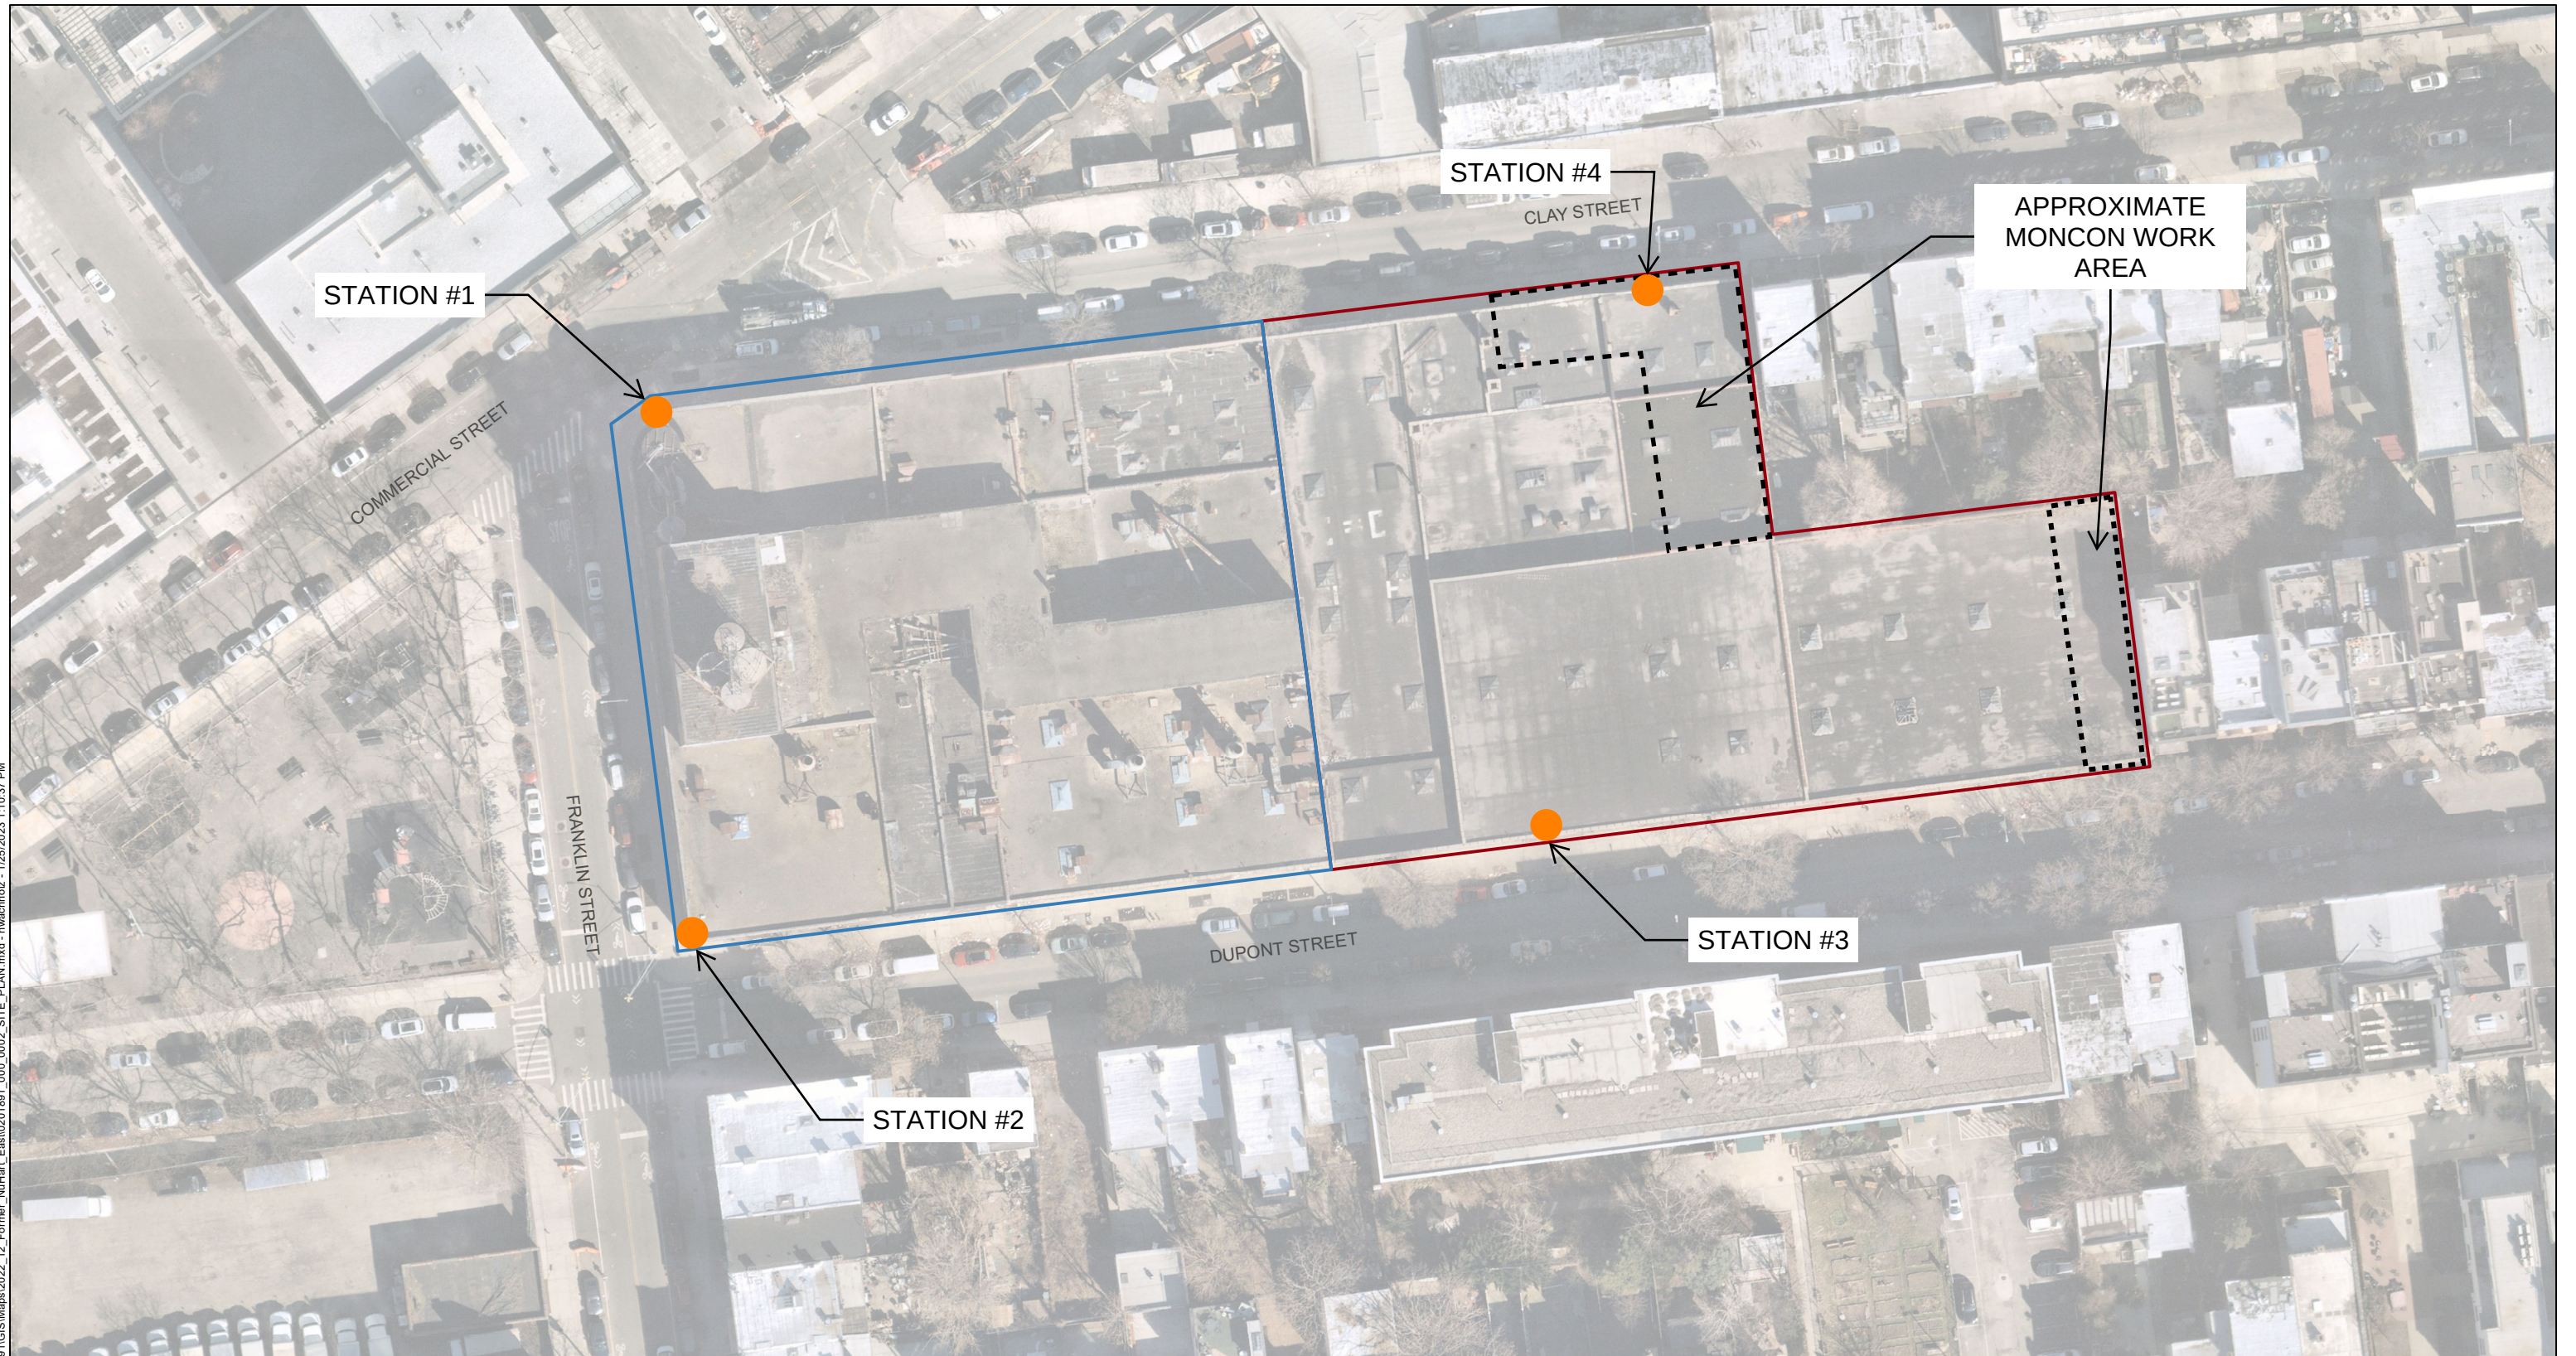

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-03-24

On-Site (OU-1) Work Activities

Personnel : A. Stewart

Weather : 44 to 57°F, Cloudy / Drizzle

Humidity : 58%

Wind Direction : NW to SE

Particulate Background (mg/m³) : 0.012PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:15		0.012	0.013			0.0	0.0			
07:30	0.013	0.011	0.013	0.030	0.0	0.0	0.0	0.0		
07:45	0.012	0.011	0.012	0.029	0.0	0.0	0.0	0.0		
08:00	0.012	0.011	0.011	0.029	0.0	0.0	0.0	0.0		
08:15	0.012	0.011	0.010	0.029	0.0	0.0	0.0	0.0		
08:30	0.012	0.011	0.010	0.032	0.0	0.0	0.0	0.0		
08:45	0.013	0.011	0.010	0.034	0.0	0.0	0.0	0.0		
09:00	0.012	0.010	0.010	0.029	0.0	0.0	0.0	0.0		
09:15	0.011	0.011	0.010	0.031	0.0	0.0	0.0	0.0		
09:30	0.011	0.010	0.009	0.029	0.0	0.0	0.0	0.0		
09:45	0.011	0.010	0.009	0.028	0.0	0.0	0.0	0.0		
10:00	0.011	0.010	0.009	0.029	0.0	0.0	0.0	0.0		
10:15	0.010	0.010	0.010	0.029	0.0	0.0	0.0	0.0		
10:30	0.010	0.010	0.009	0.034	0.0	0.0	0.0	0.0		
10:45	0.010	0.010	0.010	0.028	0.0	0.0	0.0	0.0		
11:00	0.010	0.014	0.009	0.031	0.0	0.0	0.0	0.0		
11:15	0.010	0.012	0.009	0.028	0.0	0.0	0.0	0.0		
11:30	0.009	0.010	0.009	0.029	0.0	0.0	0.0	0.0		
11:45	0.009	0.010	0.008	0.027	0.0	0.0	0.0	0.0		
12:00	0.009	0.009	0.009	0.029	0.0	0.0	0.0	0.0		
12:15	0.009	0.010	0.009	0.030	0.0	0.0	0.0	0.0		
12:30	0.009	0.010	0.011	0.027	0.0	0.0	0.0	0.0		
12:45	0.009	0.010	0.008	0.027	0.0	0.0	0.0	0.0		
13:00	0.010	0.010	0.009	0.027	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.009	0.010	0.009	0.027	0.0	0.0	0.0	0.0		
13:30	0.009	0.010	0.009	0.026	0.0	0.0	0.0	0.0		
13:45	0.009	0.010	0.009	0.026	0.0	0.0	0.0	0.0		
14:00	0.009	0.010	0.010	0.027	0.0	0.0	0.0	0.0		
14:15	0.010	0.010	0.009	0.027	0.0	0.0	0.0	0.0		
14:30	0.011	0.010	0.009	0.027	0.0	0.0	0.0	0.0		
14:45	0.010	0.010	0.009	0.026	0.0	0.0	0.0	0.0		
15:00	0.010	0.010	0.009	0.027	0.0	0.0	0.0	0.0		
15:15	0.011	0.010	0.009	0.027	0.0	0.0	0.0	0.0		
15:30	0.009	0.010	0.009	0.028	0.0	0.0	0.0	0.0		
15:45	0.010	0.010	0.009	0.026	0.0	0.0	0.0	0.0		
16:00	0.010	0.022	0.014	0.028	0.0	0.0	0.0	0.0		
16:15	0.009	0.028	0.008	0.025	0.0	0.0	0.0	0.0		
16:30	0.008	0.040	0.008	0.025	0.0	0.0	0.0	0.0		
16:45	0.011	0.023	0.011	0.026	0.0	0.0	0.0	0.0		
17:00	0.009	0.010	0.009	0.025	0.0	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	158
NYSDEC Site	NYSDEC Site 224136	Date	3/25/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	45-57°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering,	Wind Direction	From E to W up to 13 mph
Weather	Cloudy / Rain	Personnel on Site	Z. Simmel
Humidity	72%	Time on Site	8:45am to 3:00pm

Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 13.86 ft and water detected at 13.89 ft. Approximately 0.88 gallons of LNAPL recovered to date. No LNAPL detected in monitoring wells MW-45, MW-46, and MW-47.
- No intrusive work conducted.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ																Totals:
Today:	0 load	0 tons															
Total:	14 loads	168 tons															

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations on-site from 9:00am to 2:30pm. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.

Activities Planned for Coming Week:


- Continue installation of SOE and soil mix wall on site.

Site Photographs:



Photo 1: View of OU-2 restored sidewalk facing south.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\0201891_000_0002_SITE_PLAN.mxd - hwaichob - 1/25/2023 1:10:37 PM

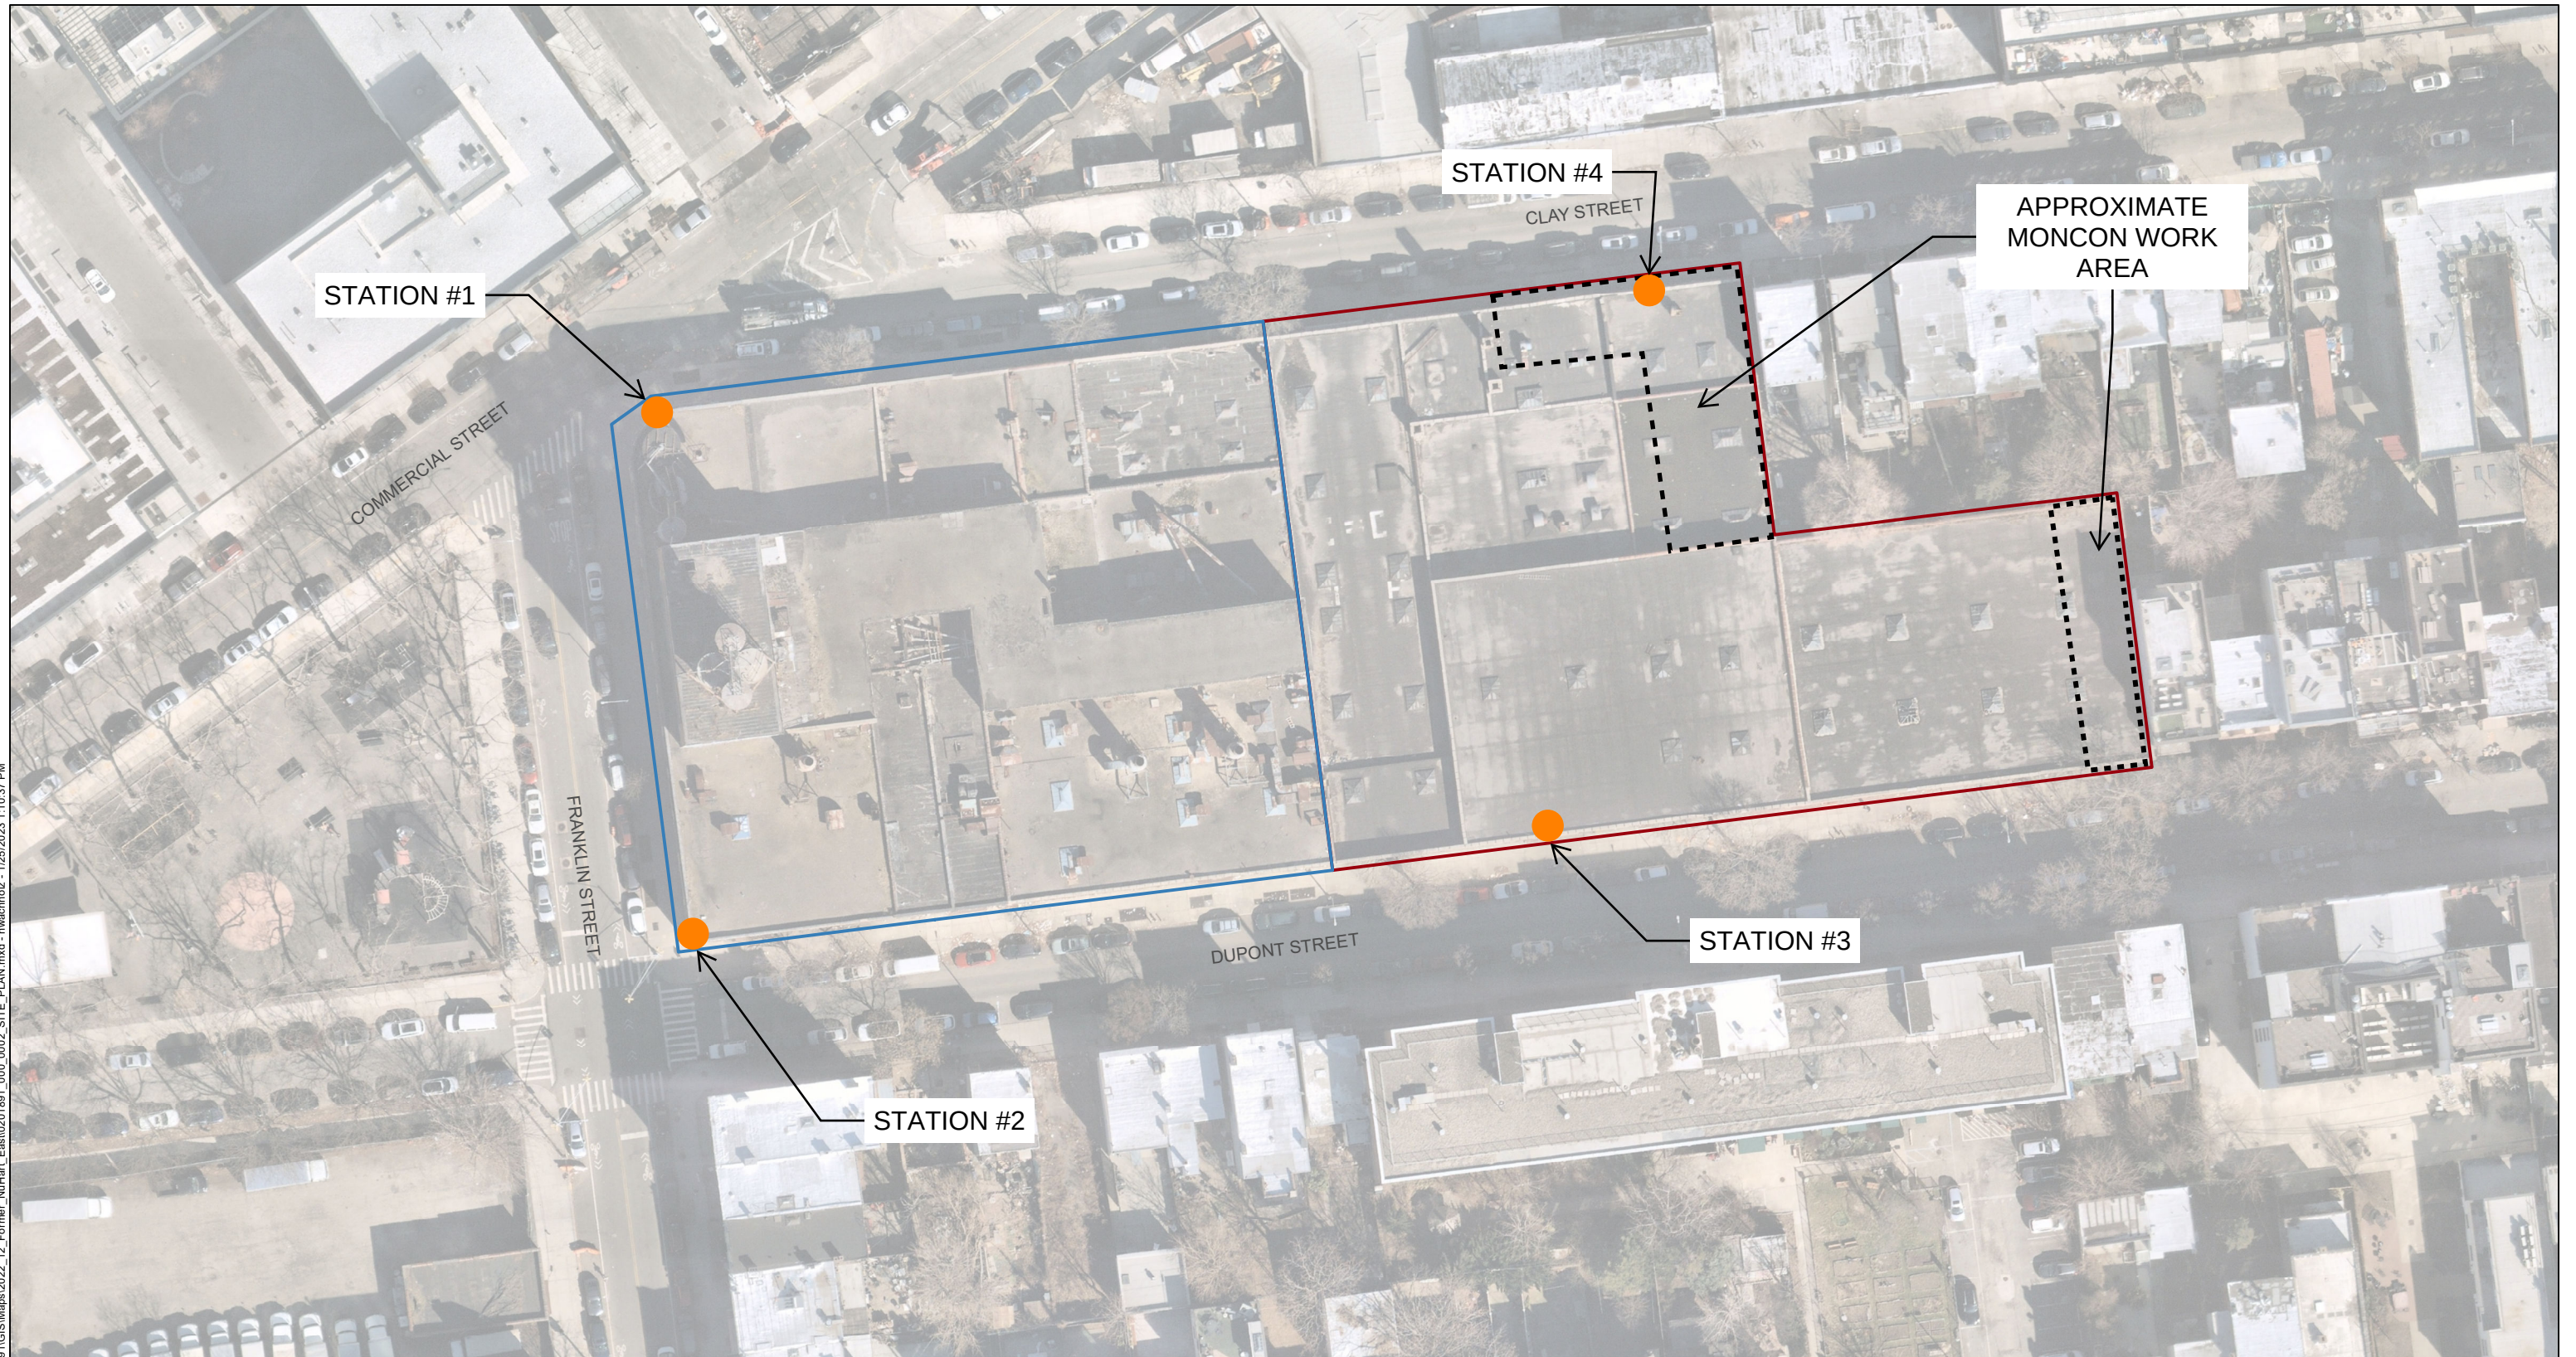

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-03-25

On-Site (OU-1) Work Activities

Personnel : Z. SimmelWeather : 45 to 57°F, Cloudy / RainHumidity : 72%Wind Direction : E to WParticulate Background (mg/m³) : 0.010PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
08:45	0.010	0.010			0.0	0.0				
09:00	0.008	0.009	0.006	0.036	0.0	0.0	0.0	0.0		
09:15	0.007	0.009	0.009	0.028	0.0	0.0	0.0	0.0		
09:30	0.007	0.009	0.012	0.026	0.0	0.0	0.0	0.0		
09:45	0.008	0.010	0.011	0.026	0.0	0.0	0.0	0.0		
10:00	0.008	0.009	0.010	0.025	0.0	0.0	0.0	0.0		
10:15	0.007	0.011	0.009	0.028	0.0	0.0	0.0	0.0		
10:30	0.007	0.010	0.006	0.027	0.0	0.0	0.0	0.0		
10:45	0.007	0.009	0.006	0.026	0.0	0.0	0.0	0.0		
11:00	0.007	0.009	0.006	0.036	0.0	0.0	0.0	0.0		
11:15	0.008	0.009	0.006	0.026	0.0	0.0	0.0	0.0		
11:30	0.008	0.009	0.006	0.026	0.0	0.0	0.0	0.0		
11:45	0.007	0.009	0.006	0.025	0.0	0.0	0.0	0.0		
12:00	0.007	0.009	0.005	0.025	0.0	0.0	0.0	0.0		
12:15	0.007	0.009	0.005	0.025	0.0	0.0	0.0	0.0		
12:30	0.007	0.009	0.006	0.025	0.0	0.0	0.0	0.0		
12:45	0.007	0.009	0.006	0.025	0.0	0.0	0.0	0.0		
13:00	0.007	0.009	0.007	0.026	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.007	0.009	0.007	0.025	0.0	0.0	0.0	0.0		
13:30	0.008	0.009	0.007	0.026	0.0	0.0	0.0	0.0		
13:45	0.008	0.009	0.012	0.025	0.0	0.0	0.0	0.0		
14:00	0.008	0.009	0.017	0.026	0.0	0.0	0.0	0.0		
14:15	0.008	0.009	0.007	0.026	0.0	0.0	0.0	0.0		
14:30	0.008	0.009	0.008	0.026	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 13.81 ft and water detected at 13.84 ft. Approximately 0.88 gallons of LNAPL recovered to date. No LNAPL detected in monitoring wells MW-45, MW-46, and MW-47.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Material Export:

- | | | | | | | | | | |
|--------|--------------------------------|-------------|--|--|--|--|--|--|---------|
| | Clean Earth of
Carteret, NJ | | | | | | | | Totals: |
| Today: | 0
load | 0
tons | | | | | | | |
| Total: | 14
loads | 168
tons | | | | | | | |

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

- None

Community air monitoring was performed at two upwind and two downwind locations on-site from 7:15 am to 5:30 pm. No intrusive work conducted on site. No 15-minute average concentrations of particulates or VOCs exceeded action levels at the CAMP stations. No visible dust was observed leaving the site.


- Continue installation of SOE and soil mix wall in OU-1.

Site Photographs:



Photo 1: View of the site facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwaichob - 1/25/2023 1:10:37 PM

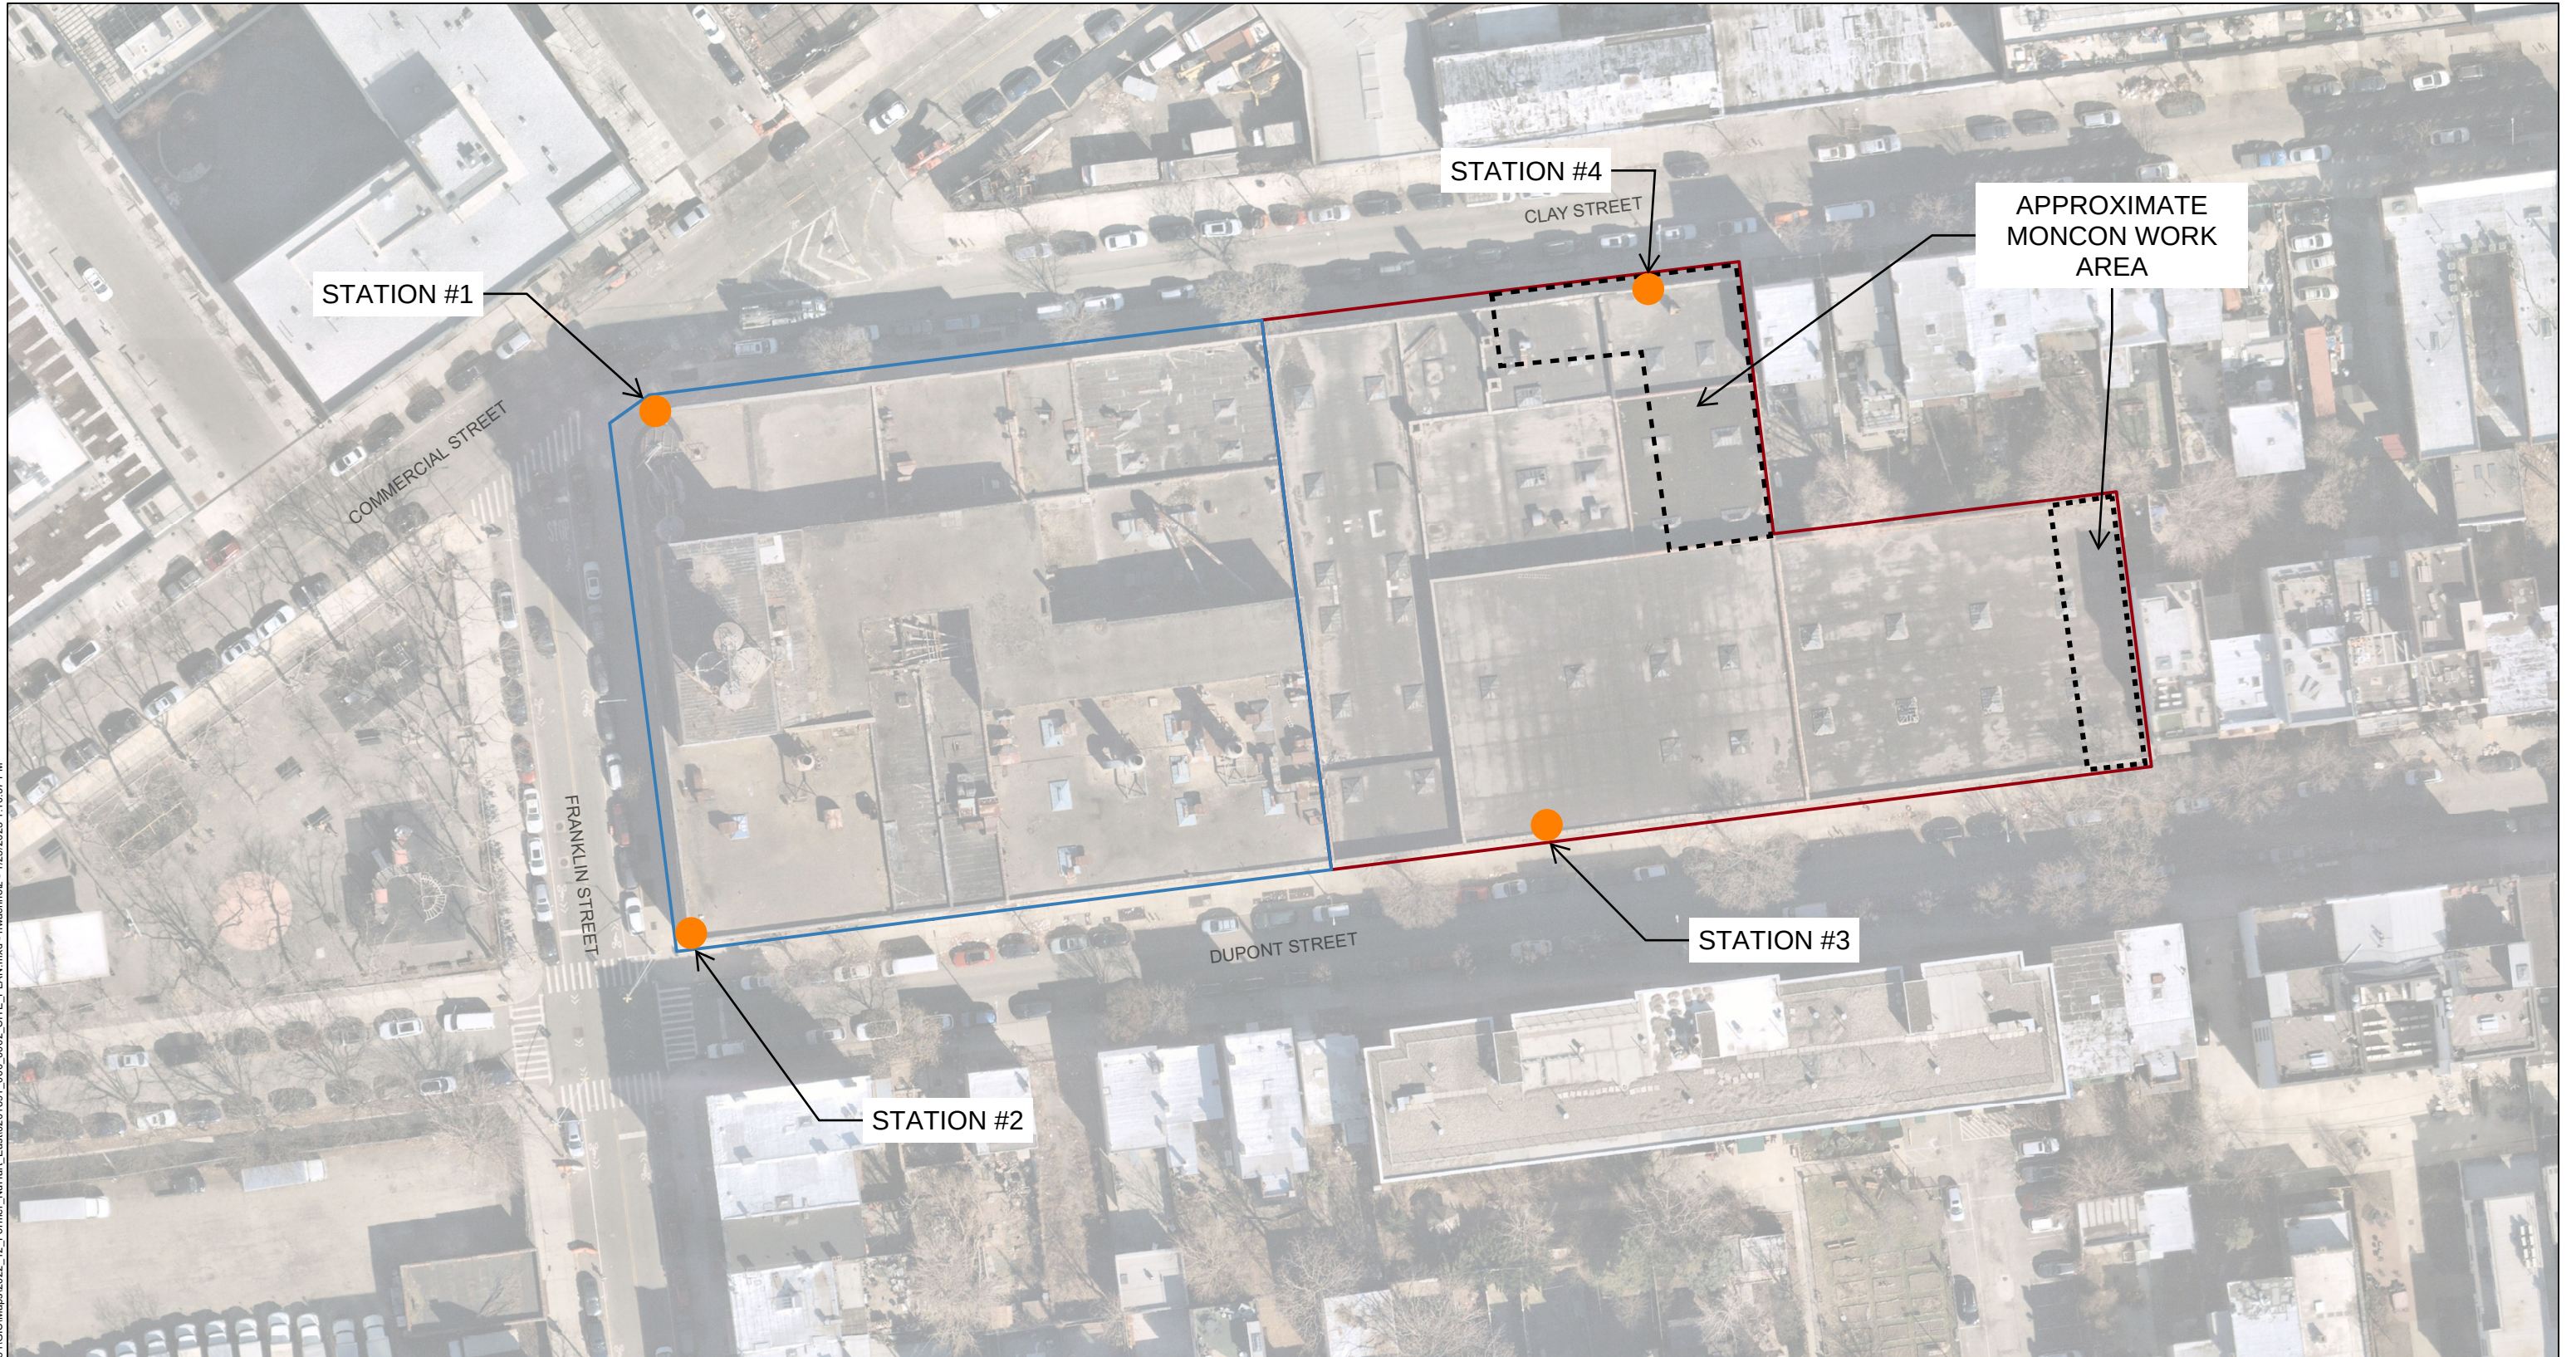

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-03-27

On-Site (OU-1) Work Activities

Personnel : A. StewartWeather : 43-58°F, SunnyHumidity : 54%Wind Direction : NE to SWParticulate Background (mg/m³) : 0.017PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:15	0.017	0.019	0.017	0.071	0.0	0.0	0.0	0.0		
07:30	0.017	0.012	0.012	0.037	0.0	0.0	0.0	0.0		
07:45	0.008	0.009	0.010	0.028	0.0	0.0	0.0	0.0		
08:00	0.009	0.011	0.007	0.027	0.0	0.0	0.0	0.0		
08:15	0.008	0.010	0.008	0.055	0.0	0.0	0.0	0.0		
08:30	0.008	0.010	0.008	0.030	0.0	0.0	0.0	0.0		
08:45	0.008	0.010	0.008	0.028	0.0	0.0	0.0	0.0		
09:00	0.007	0.010	0.007	0.028	0.0	0.0	0.0	0.0		
09:15	0.008	0.010	0.007	0.027	0.0	0.0	0.0	0.0		
09:30	0.007	0.010	0.008	0.028	0.0	0.0	0.0	0.0		
09:45	0.008	0.010	0.008	0.028	0.0	0.0	0.0	0.0		
10:00	0.008	0.010	0.010	0.027	0.0	0.0	0.0	0.0		
10:15	0.008	0.010	0.008	0.026	0.0	0.0	0.0	0.0		
10:30	0.007	0.010	0.007	0.026	0.0	0.0	0.0	0.0		
10:45	0.007	0.010	0.008	0.027	0.0	0.0	0.0	0.0		
11:00	0.008	0.009	0.007	0.028	0.0	0.0	0.0	0.0		
11:15	0.007	0.009	0.008	0.025	0.0	0.0	0.0	0.0		
11:30	0.009	0.010	0.008	0.026	0.0	0.0	0.0	0.0		
11:45	0.008	0.010	0.007	0.026	0.0	0.0	0.0	0.0		
12:00	0.007	0.010	0.006	0.024	0.0	0.0	0.0	0.0		
12:15	0.007	0.010	0.006	0.023	0.0	0.0	0.0	0.0		
12:30	0.006	0.009	0.006	0.024	0.0	0.0	0.0	0.0		
12:45	0.007	0.009	0.007	0.023	0.0	0.0	0.0	0.0		
13:00	0.006	0.009	0.007	0.023	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.007	0.010	0.007	0.024	0.0	0.0	0.0	0.0		
13:30	0.007	0.010	0.016	0.025	0.0	0.0	0.0	0.0		
13:45	0.007	0.011	0.008	0.025	0.0	0.0	0.0	0.0		
14:00	0.007	0.010	0.010	0.025	0.0	0.0	0.0	0.0		
14:15	0.007	0.010	0.012	0.025	0.0	0.0	0.0	0.0		
14:30	0.007	0.012	0.008	0.025	0.0	0.0	0.0	0.0		
14:45	0.007	0.010	0.010	0.027	0.0	0.0	0.0	0.0		
15:00	0.008	0.010	0.010	0.026	0.0	0.0	0.0	0.0		
15:15	0.008	0.010	0.012	0.027	0.0	0.0	0.0	0.0		
15:30	0.007	0.010	0.007	0.026	0.0	0.0	0.0	0.0		
15:45	0.008	0.010	0.007	0.026	0.0	0.0	0.0	0.0		
16:00	0.009	0.012	0.009	0.027	0.0	0.0	0.0	0.0		
16:15	0.010	0.010	0.015	0.028	0.0	0.0	0.0	0.0		
16:30	0.010	0.010	0.011	0.028	0.0	0.0	0.0	0.0		
16:45	0.010	0.009	0.008	0.028	0.0	0.0	0.0	0.0		
17:00	0.010	0.009	0.011	0.027	0.0	0.0	0.0	0.0		
17:15	0.010	0.009	0.007	0.026	0.0	0.0	0.0	0.0		
17:30	0.010	0.009	0.007	0.026	0.0	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	159
NYSDEC Site	NYSDEC Site 224136	Date	3/28/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	42-52°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering	Wind Direction	From NW to SE up to 10 mph
Weather	Cloudy	Personnel on Site	M. Boland
Humidity	64%	Time on Site	7:00am to 5:45pm

Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 14.04 ft and water detected at 14.10 ft. Approximately 0.88 gallons of LNAPL recovered to date. No LNAPL detected in monitoring wells MW-45, MW-46, and MW-47.
- Contractor drilling through obstructions inhibiting sheet pile installation along northern portion of the site.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ												Totals:
Today:	0 load	0 tons											
Total:	<u>15</u> loads	<u>180</u> tons											

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:00 am to 5:30 pm. Equipment malfunction at CAMP station #1 at 1:15 pm and 5:15 pm; visual and olfactory monitoring conducted during this time, issue was troubleshooted and

resolved. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

Activities Planned for Coming Week:

- Continue installation of SOE and soil mix wall in OU-1.


Site Photographs:

Photo 1: View of contractor drilling through sheet pile obstructions facing west.



Photo 1: View of restored OU-2 sidewalk facing southwest.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwaeholz - 1/25/2023 1:10:37 PM

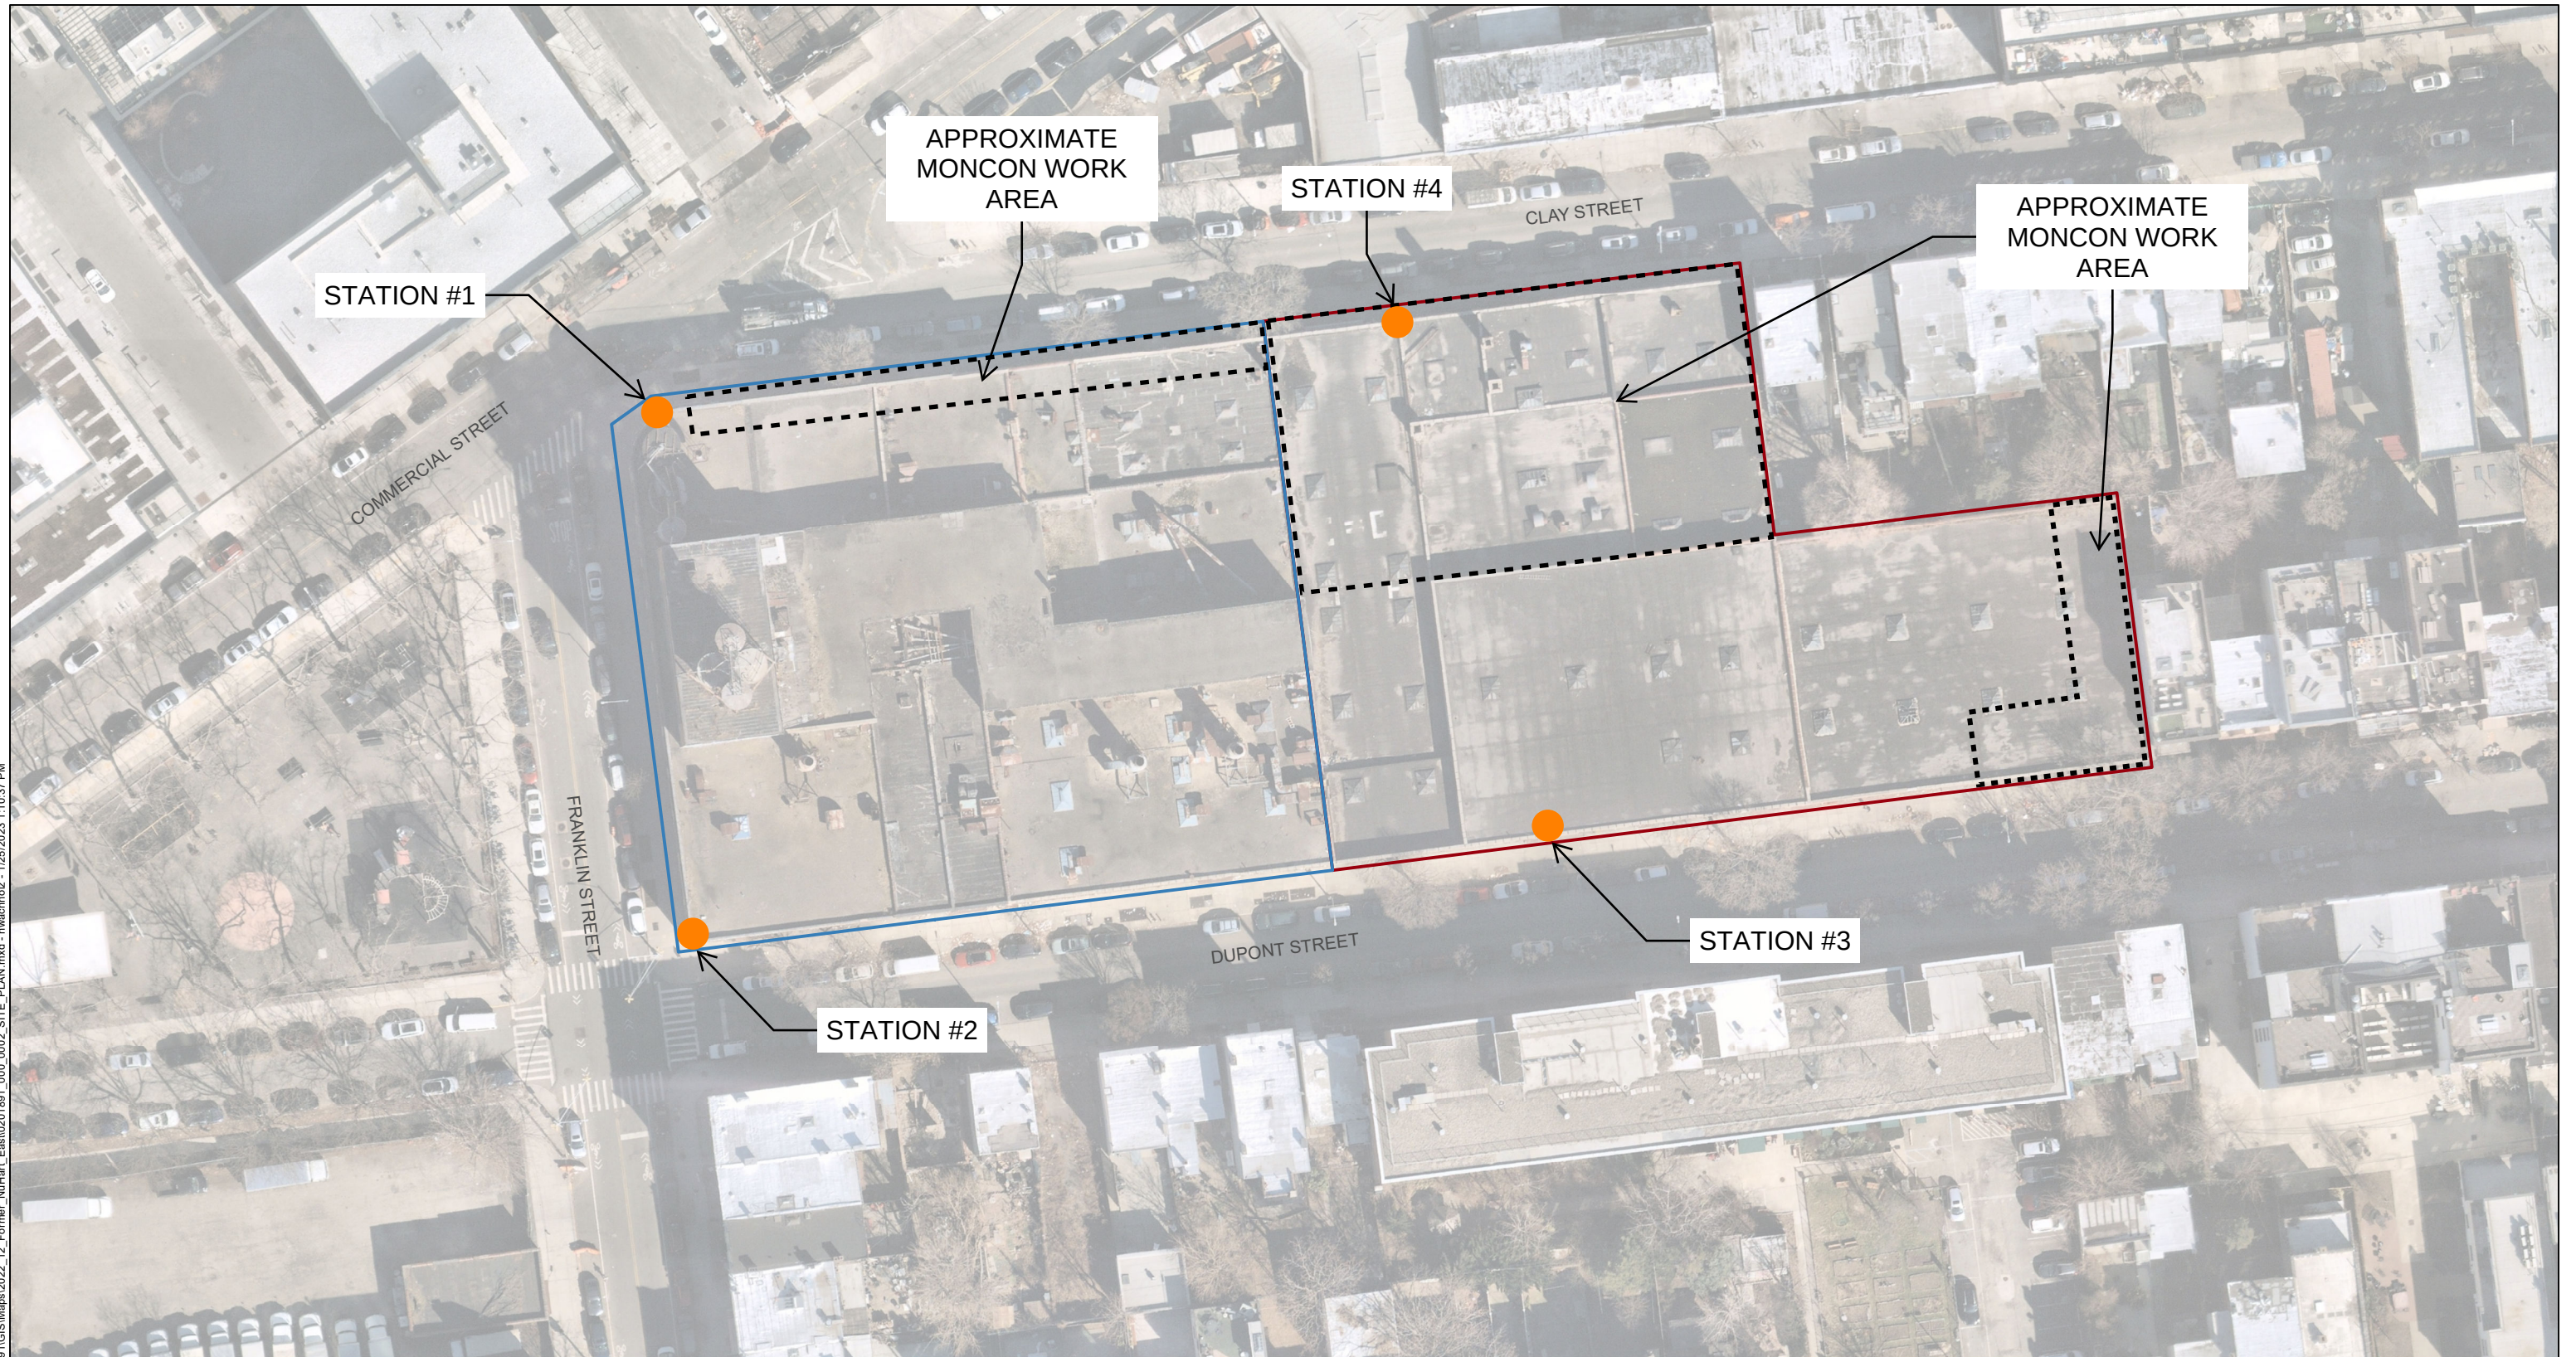

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-03-28

On-Site (OU-1) Work Activities

Personnel : M. Boland

Weather : 42 to 52°F, Cloudy

Humidity : 64%

Wind Direction : NW to SE

Particulate Background (mg/m³) : 0.018PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.018	0.015	0.018	0.041	0.0	0.0	0.0	0.0		
07:15	0.014	0.013	0.014	0.034	0.0	0.0	0.0	0.0		
07:30	0.013	0.012	0.012	0.032	0.0	0.0	0.0	0.0		
07:45	0.010	0.011	0.017	0.029	0.0	0.0	0.0	0.0		
08:00	0.009	0.010	0.009	0.031	0.0	0.0	0.0	0.0		
08:15	0.009	0.010	0.008	0.028	0.0	0.0	0.0	0.0		
08:30	0.008	0.010	0.007	0.027	0.0	0.0	0.0	0.0		
08:45	0.008	0.009	0.009	0.026	0.0	0.0	0.0	0.0		
09:00	0.008	0.009	0.006	0.026	0.0	0.0	0.0	0.0		
09:15	0.007	0.008	0.007	0.025	0.0	0.0	0.0	0.0		
09:30	0.007	0.008	0.004	0.025	0.0	0.0	0.0	0.0		
09:45	0.006	0.008	0.005	0.025	0.0	0.0	0.0	0.0		
10:00	0.007	0.008	0.005	0.025	0.0	0.0	0.0	0.0		
10:15	0.006	0.008	0.005	0.025	0.0	0.0	0.0	0.0		
10:30	0.006	0.008	0.008	0.026	0.0	0.0	0.0	0.0		
10:45	0.007	0.008	0.006	0.026	0.0	0.0	0.0	0.0		
11:00	0.006	0.008	0.005	0.026	0.0	0.0	0.0	0.0		
11:15	0.007	0.008	0.007	0.029	0.0	0.0	0.0	0.0		
11:30	0.007	0.008	0.009	0.026	0.0	0.0	0.0	0.0		
11:45	0.007	0.009	0.007	0.027	0.0	0.0	0.0	0.1		
12:00	0.007	0.009	0.006	0.028	0.0	0.0	0.0	0.0		
12:15	0.007	0.008	0.008	0.025	0.0	0.0	0.0	0.0		
12:30	0.006	0.008	0.005	0.025	0.0	0.0	0.0	0.0		
12:45	0.007	0.009	0.005	0.026	0.0	0.0	0.0	0.0		
13:00	0.006	0.009	0.005	0.026	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15		0.008	0.006	0.028		0.0	0.0	0.0		Equipment malfunction occurred at Station 1, troubleshoot issue and Station running again by 13:30, visual & olfactory monitoring conducted during this time, no visual dust observed
13:30	0.007	0.008	0.006	0.025	0.0	0.0	0.0	0.0		
13:45	0.007	0.008	0.006	0.026	0.0	0.0	0.0	0.0		
14:00	0.007	0.008	0.007	0.025	0.0	0.0	0.0	0.0		
14:15	0.007	0.008	0.006	0.026	0.0	0.0	0.0	0.0		
14:30	0.007	0.008	0.006	0.027	0.0	0.0	0.0	0.0		
14:45	0.006	0.008	0.006	0.026	0.0	0.0	0.0	0.0		
15:00	0.006	0.008	0.006	0.026	0.0	0.0	0.0	0.0		
15:15	0.006	0.008	0.005	0.025	0.0	0.0	0.0	0.1		
15:30	0.006	0.008	0.005	0.027	0.0	0.0	0.0	0.1		
15:45	0.006	0.008	0.005	0.025	0.0	0.0	0.0	0.0		
16:00	0.006	0.008	0.005	0.025	0.0	0.0	0.0	0.0		
16:15	0.006	0.008	0.005	0.028	0.0	0.0	0.0	0.0		
16:30	0.006	0.008	0.006	0.025	0.0	0.0	0.0	0.0		
16:45	0.007	0.008	0.005	0.025	0.0	0.0	0.0	0.0		Equipment malfunction occurred at Station 1, troubleshoot issue, visual & olfactory monitoring conducted during this time, no visual dust observed
17:00	0.006	0.008	0.005	0.027	0.0	0.0	0.0	0.0		
17:15		0.008	0.005	0.024		0.0	0.0	0.0		
17:30		0.008	0.006			0.0	0.0			

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	160
NYSDEC Site	NYSDEC Site 224136	Date	3/29/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	42-54°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering	Wind Direction	From NW to SE up to 5 mph
Weather	Cloudy	Personnel on Site	S. Sotomayor
Humidity	59%	Time on Site	7:00am to 5:45pm

Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 14.01 ft and water detected at 14.05 ft. Approximately 0.88 gallons of LNAPL recovered to date.
- Contractor drilling through obstructions inhibiting sheet pile installation along southwest portion of the site.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ												Totals:
Today:	0 load	0 tons											
Total:	15 loads	180 tons											

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:30 am to 5:30 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.


Activities Planned for Coming Week:

- Continue installation of SOE and soil mix wall in OU-1.

Site Photographs:

Photo 1: View of site facing southwest.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Map\2022_12_Fomer_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwaichob - 1/25/2023 1:10:37 PM

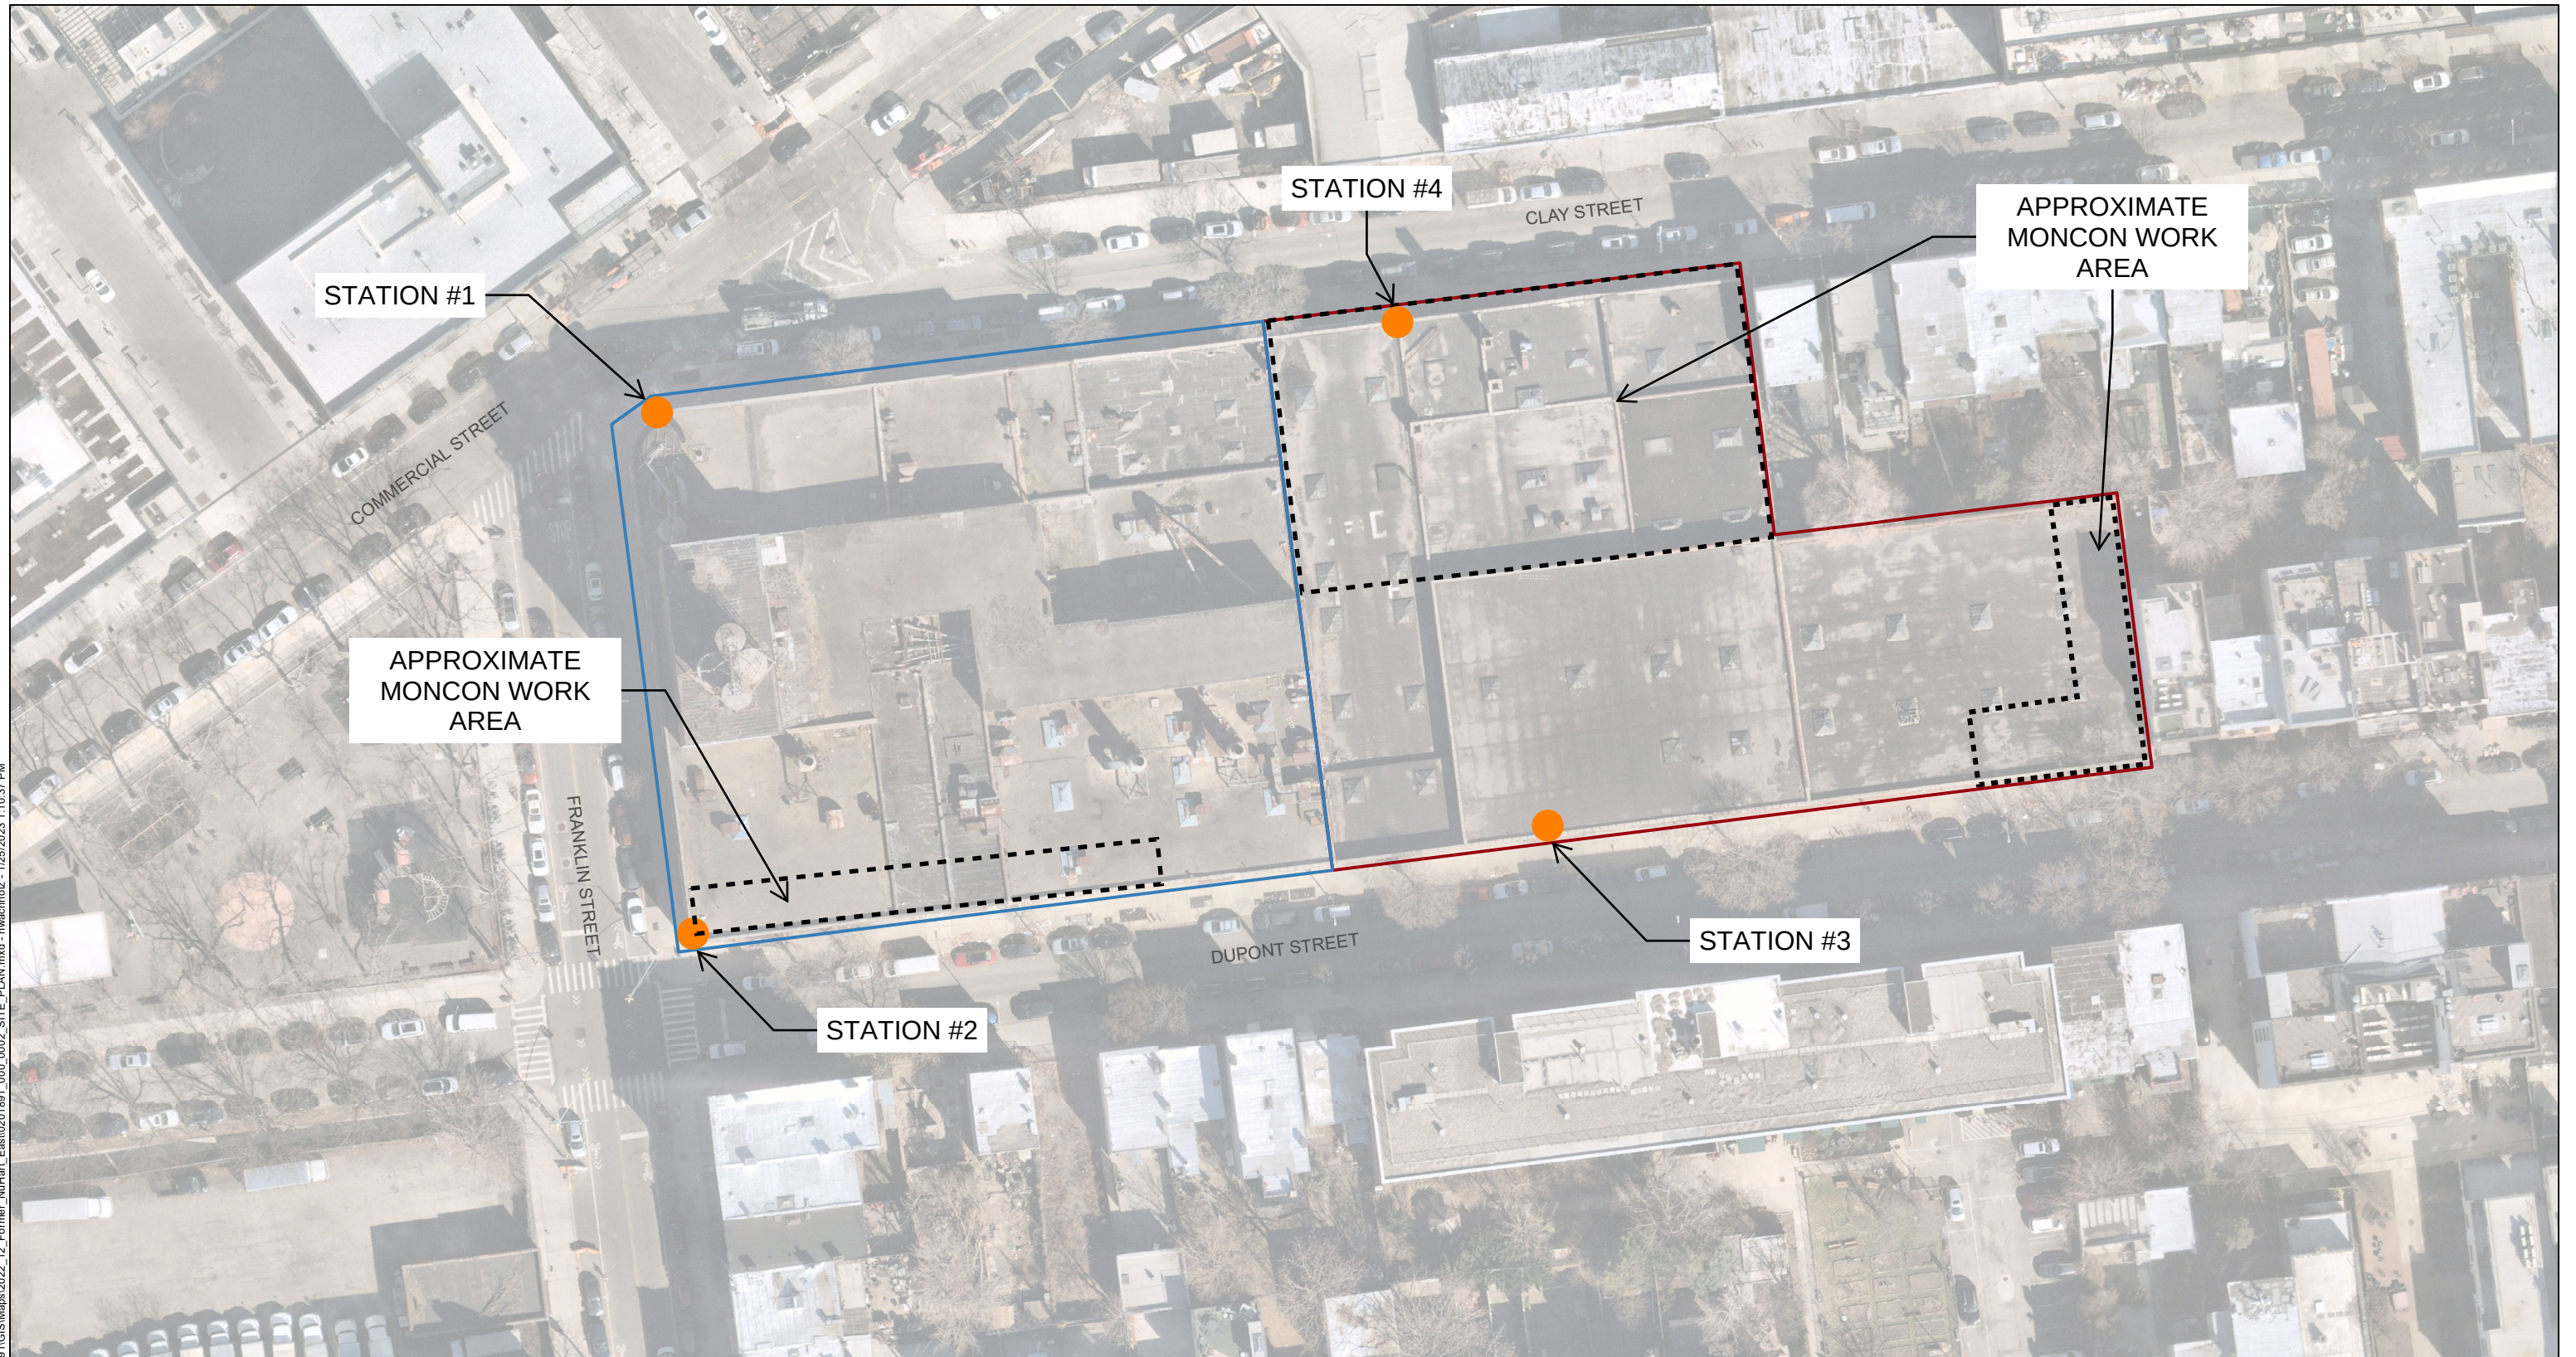

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-03-29

On-Site (OU-1) Work Activities

Personnel : S. SotomayorWeather : 42 to 54°F, CloudyHumidity : 59%Wind Direction : NW to SEParticulate Background (mg/m³) : 0.009PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:30	0.027	0.009	0.007	0.028	0.0	0.0	0.0	0.0		
07:45	0.013	0.009	0.006	0.026	0.0	0.0	0.0	0.0		
08:00	0.009	0.008	0.006	0.026	0.0	0.0	0.0	0.0		
08:15	0.009	0.009	0.007	0.027	0.0	0.0	0.0	0.0		
08:30	0.008	0.009	0.006	0.026	0.0	0.0	0.0	0.0		
08:45	0.008	0.008	0.006	0.027	0.0	0.0	0.0	0.0		
09:00	0.008	0.009	0.007	0.026	0.0	0.0	0.0	0.0		
09:15	0.008	0.010	0.007	0.027	0.0	0.0	0.0	0.0		
09:30	0.007	0.009	0.005	0.026	0.0	0.0	0.0	0.0		
09:45	0.007	0.008	0.006	0.025	0.0	0.0	0.0	0.0		
10:00	0.006	0.008	0.006	0.026	0.0	0.0	0.0	0.0		
10:15	0.006	0.027	0.007	0.025	0.0	0.0	0.0	0.0		
10:30	0.006	0.027	0.006	0.025	0.0	0.0	0.0	0.0		
10:45	0.007	0.017	0.006	0.025	0.0	0.0	0.0	0.0		
11:00	0.006	0.012	0.006	0.025	0.0	0.0	0.0	0.0		
11:15	0.007	0.009	0.005	0.025	0.0	0.0	0.0	0.0		
11:30	0.006	0.009	0.006	0.024	0.0	0.0	0.0	0.0		
11:45	0.006	0.010	0.006	0.024	0.0	0.0	0.0	0.0		
12:00	0.007	0.014	0.006	0.024	0.0	0.0	0.0	0.0		
12:15	0.007	0.011	0.008	0.029	0.0	0.0	0.0	0.0		
12:30	0.006	0.008	0.006	0.023	0.0	0.0	0.0	0.0		
12:45	0.006	0.008	0.006	0.023	0.0	0.0	0.0	0.0		
13:00	0.006	0.008	0.006	0.024	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.007	0.009	0.008	0.025	0.0	0.0	0.0	0.0		
13:30	0.006	0.008	0.007	0.023	0.0	0.0	0.0	0.0		
13:45	0.006	0.008	0.007	0.024	0.0	0.0	0.0	0.0		
14:00	0.006	0.008	0.006	0.023	0.0	0.0	0.0	0.0		
14:15	0.006	0.008	0.007	0.024	0.0	0.0	0.0	0.0		
14:30	0.007	0.009	0.007	0.024	0.0	0.0	0.0	0.0		
14:45	0.007	0.010	0.007	0.025	0.0	0.0	0.0	0.0		
15:00	0.007	0.010	0.007	0.025	0.0	0.0	0.0	0.0		
15:15	0.008	0.009	0.008	0.025	0.0	0.0	0.0	0.0		
15:30	0.007	0.009	0.007	0.024	0.0	0.0	0.0	0.0		
15:45	0.007	0.009	0.007	0.024	0.0	0.0	0.0	0.0		
16:00	0.008	0.010	0.008	0.025	0.0	0.0	0.0	0.0		
16:15	0.007	0.009	0.007	0.028	0.0	0.0	0.0	0.0		
16:30	0.007	0.009	0.007	0.026	0.0	0.0	0.0	0.0		
16:45	0.010	0.010	0.009	0.030	0.0	0.2	0.0	0.0		
17:00	0.010	0.010	0.008	0.027	0.0	0.0	0.0	0.0		
17:15	0.010	0.010	0.008	0.027	0.0	0.0	0.0	0.0		
17:30	0.009	0.010	0.008	0.026	0.0	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	161
NYSDEC Site	NYSDEC Site 224136	Date	3/30/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	35-40°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering	Wind Direction	From NW to SE up to 13 mph
Weather	Sunny	Personnel on Site	S. Sotomayor
Humidity	46%	Time on Site	7:00am to 5:00pm

Haley & Aldrich of New York (Haley & Aldrich) was present observe the contractor drill through obstructions along the southwest portion of the site, and to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 13.94 ft and water detected at 13.99 ft. Approximately 0.88 gallons of LNAPL recovered to date.
- Contractor drilling through obstructions inhibiting sheet pile installation along southwest portion of the site.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ													Totals:
Today:	0 load	0 tons												
Total:	15 loads	180 tons												

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:30 am to 4:45 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.


Activities Planned for Coming Week:

- Continue installation of SOE and soil mix wall in OU-1.

Site Photographs:

Photo 1: View of drill rig mobilized to clear obstructions for sheet pile installation.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Map\2022_12_Fomer_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwaichob - 1/25/2023 1:10:37 PM

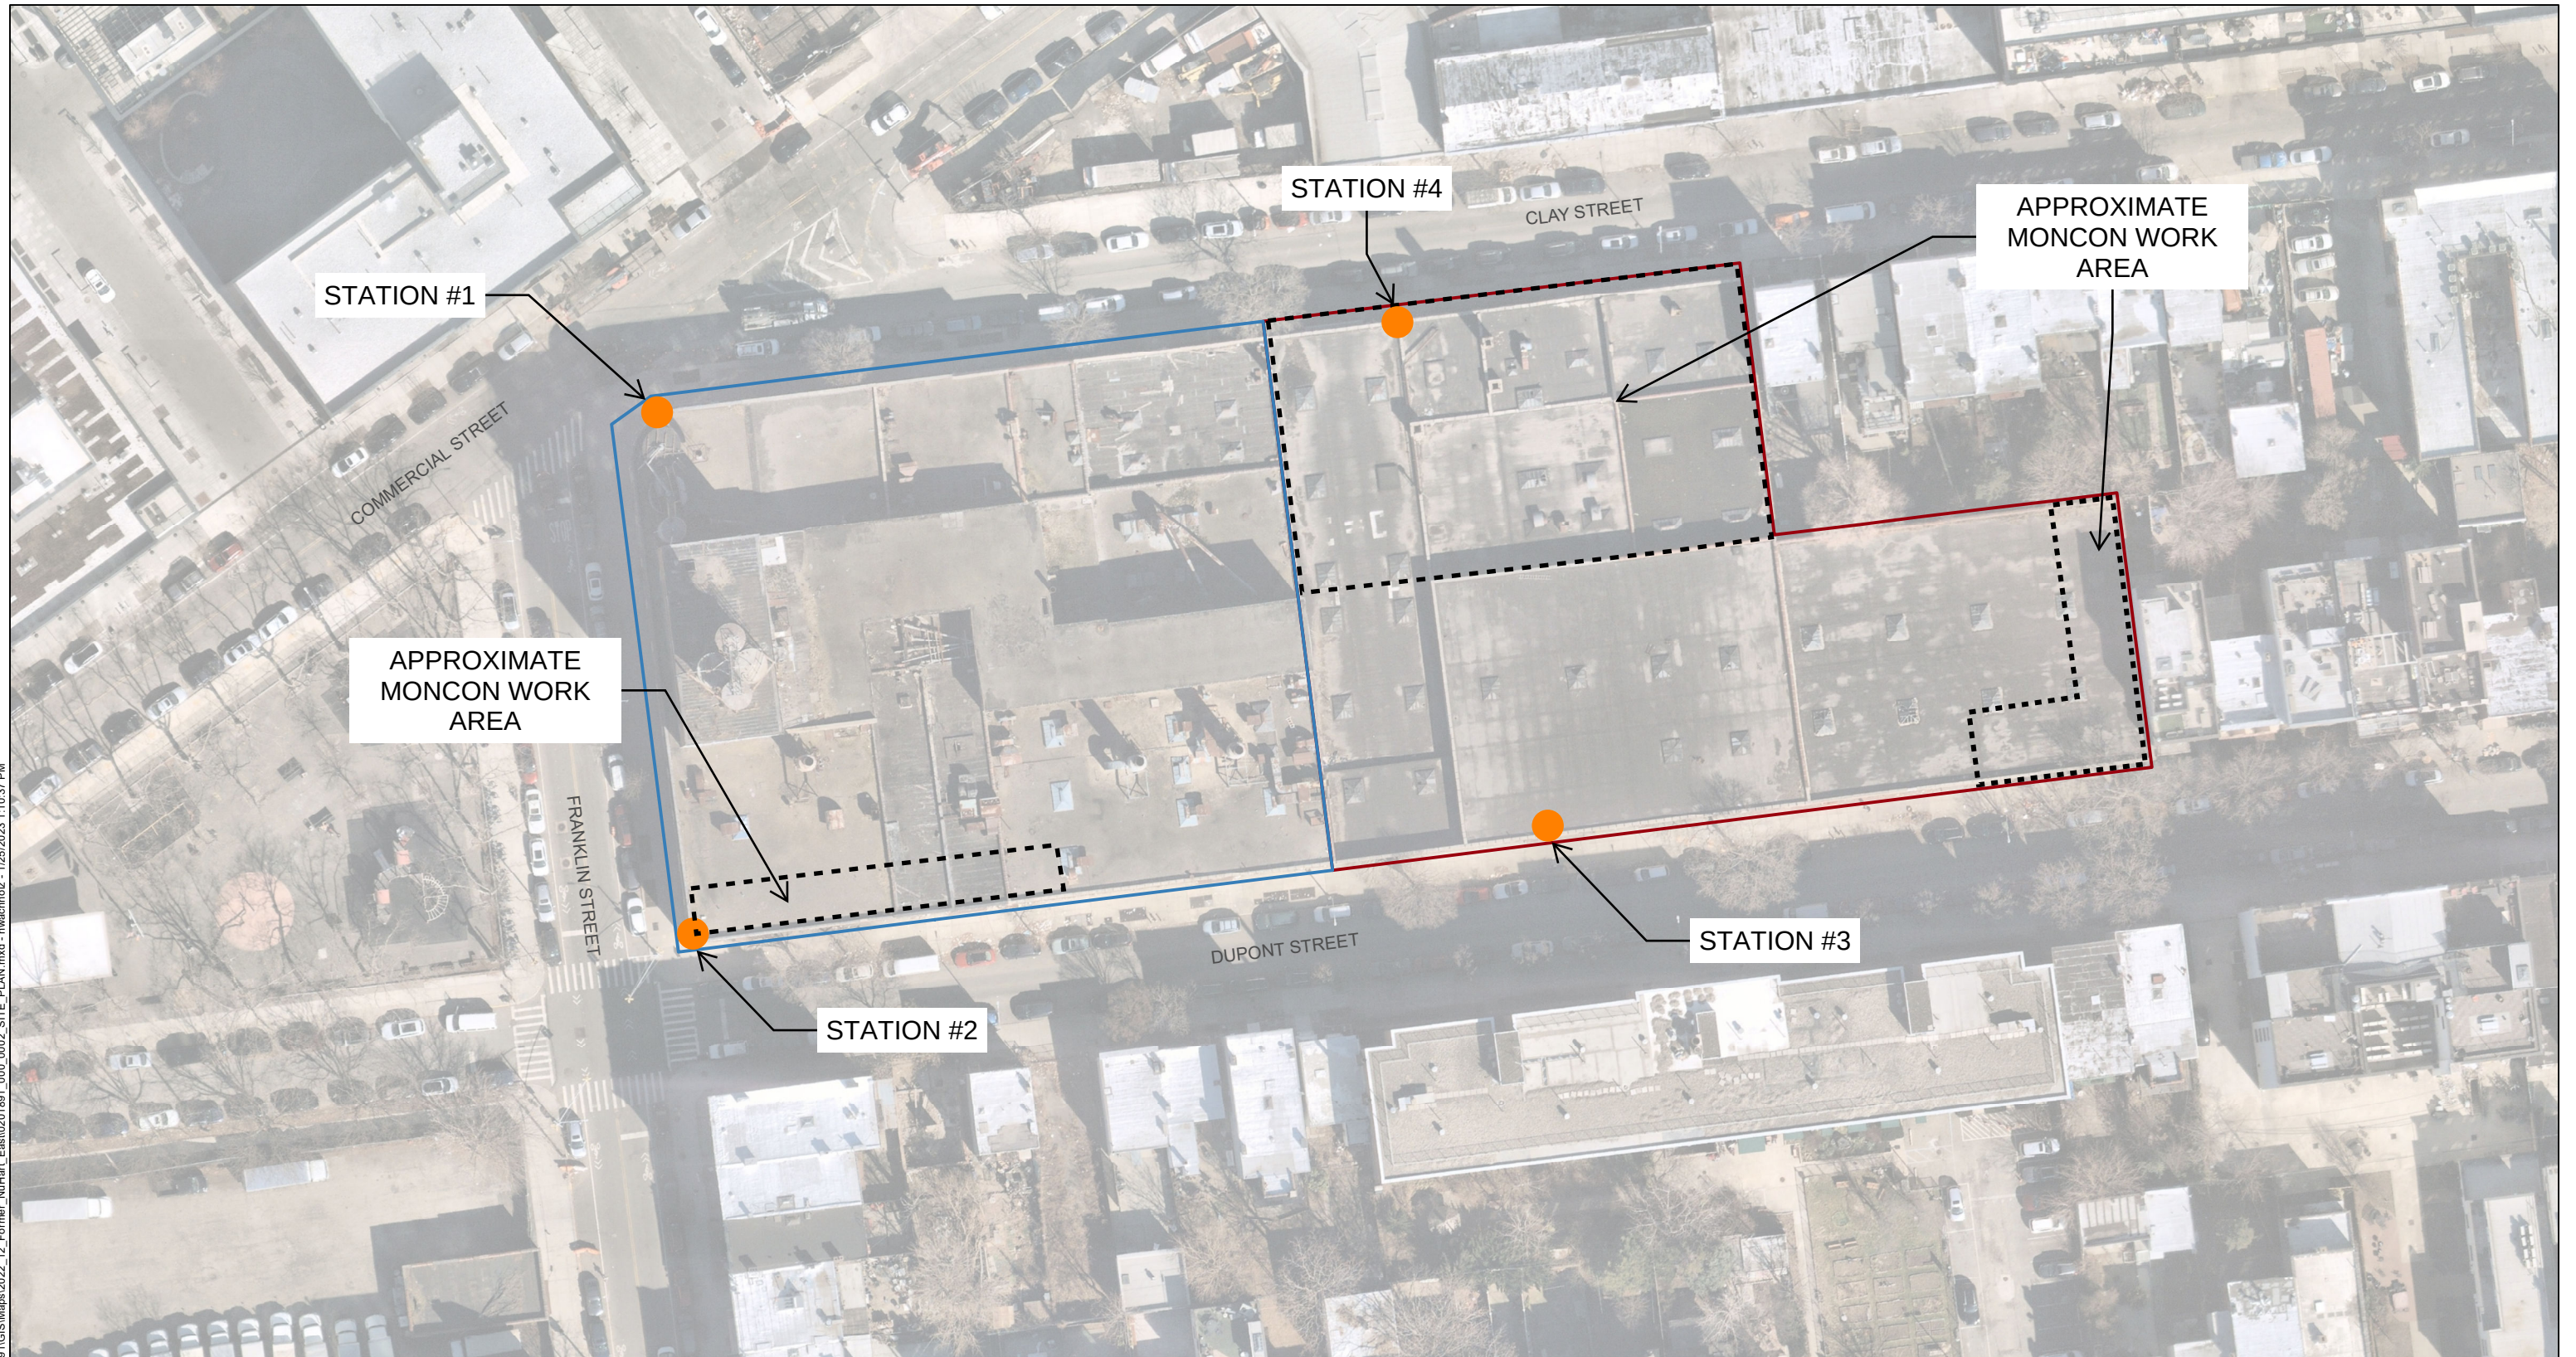

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-03-30

On-Site (OU-1) Work Activities

Personnel : S. SotomayorWeather : 35 to 40°F, SunnyHumidity : 46%Wind Direction : NW to SEParticulate Background (mg/m³) : 0.011PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:30	0.011	0.009	0.014	0.052	0.0	0.0	0.0	0.0		
07:45	0.007	0.009	0.008	0.034	0.0	0.0	0.0	0.0		
08:00	0.007	0.009	0.006	0.026	0.0	0.0	0.0	0.0		
08:15	0.006	0.009	0.005	0.026	0.0	0.0	0.0	0.0		
08:30	0.006	0.008	0.005	0.031	0.0	0.0	0.0	0.0		
08:45	0.007	0.009	0.005	0.029	0.0	0.0	0.0	0.0		
09:00	0.007	0.010	0.005	0.036	0.0	0.0	0.0	0.0		
09:15	0.007	0.011	0.005	0.033	0.0	0.0	0.0	0.0		
09:30	0.007	0.009	0.005	0.033	0.0	0.0	0.0	0.0		
09:45	0.007	0.009	0.005	0.029	0.0	0.0	0.0	0.0		
10:00	0.008	0.009	0.005	0.032	0.0	0.0	0.0	0.0		
10:15	0.007	0.008	0.005	0.033	0.0	0.0	0.0	0.0		
10:30	0.007	0.008	0.004	0.032	0.0	0.0	0.0	0.0		
10:45	0.006	0.008	0.005	0.032	0.0	0.0	0.0	0.0		
11:00	0.006	0.008	0.013	0.029	0.0	0.0	0.0	0.0		
11:15	0.006	0.008	0.007	0.028	0.0	0.0	0.0	0.0		
11:30	0.006	0.009	0.005	0.027	0.0	0.0	0.0	0.0		
11:45	0.006	0.009	0.006	0.030	0.0	0.0	0.0	0.0		
12:00	0.006	0.009	0.005	0.027	0.0	0.0	0.0	0.0		
12:15	0.006	0.009	0.007	0.027	0.0	0.0	0.0	0.0		
12:30	0.006	0.009	0.005	0.025	0.0	0.0	0.0	0.0		
12:45	0.006	0.008	0.005	0.027	0.0	0.0	0.0	0.0		
13:00	0.005	0.008	0.004	0.026	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.006	0.008	0.008	0.029	0.0	0.0	0.0	0.0		
13:30	0.006	0.008	0.009	0.030	0.0	0.0	0.0	0.0		
13:45	0.006	0.008	0.006	0.029	0.0	0.0	0.0	0.0		
14:00	0.006	0.009	0.007	0.049	0.0	0.0	0.0	0.0		
14:15	0.007	0.009	0.006	0.030	0.0	0.0	0.0	0.0		
14:30	0.008	0.009	0.005	0.032	0.0	0.0	0.0	0.0		
14:45	0.007	0.009	0.007	0.029	0.0	0.0	0.0	0.0		
15:00	0.008	0.008	0.005	0.031	0.0	0.0	0.0	0.0		
15:15	0.007	0.008	0.005	0.032	0.0	0.0	0.0	0.0		
15:30	0.007	0.008	0.006	0.027	0.0	0.0	0.0	0.0		
15:45	0.007	0.010	0.007	0.027	0.0	0.0	0.0	0.0		
16:00	0.007	0.009	0.006	0.029	0.0	0.0	0.0	0.0		
16:15	0.007	0.008	0.006	0.028	0.0	0.0	0.0	0.0		
16:30	0.006	0.009	0.006	0.027	0.0	0.0	0.0	0.0		
16:45	0.007	0.010	0.006	0.027	0.0	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	162
NYSDEC Site	NYSDEC Site 224136	Date	3/31/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	42-50°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering	Wind Direction	From NW to SE up to 6 mph
Weather	Sunny	Personnel on Site	S. Sotomayor
Humidity	54%	Time on Site	7:00am to 5:30pm

Haley & Aldrich of New York (Haley & Aldrich) was present observe the contractor drilling through obstructions along the southwest portion of the site, and to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 13.90 ft and water detected at 13.93 ft. Approximately 0.88 gallons of LNAPL recovered to date.
- Contractor drilling through obstructions inhibiting sheet pile installation along southwest portion of the site.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ													Totals:
Today:	0 load	0 tons												
Total:	15 loads	180 tons												

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:15 am to 5:15 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.


Activities Planned for Coming Week:

- Continue installation of SOE and soil mix wall in OU-1.

Site Photographs:

Photo 1: View of drill rig clearing obstructions for sheet pile installation, facing northeast.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Map\2022_12_Former_Nuhart_East\20210891_000_0002_SITE_PLAN.mxd - hwalcholz - 1/25/2023 1:10:37 PM

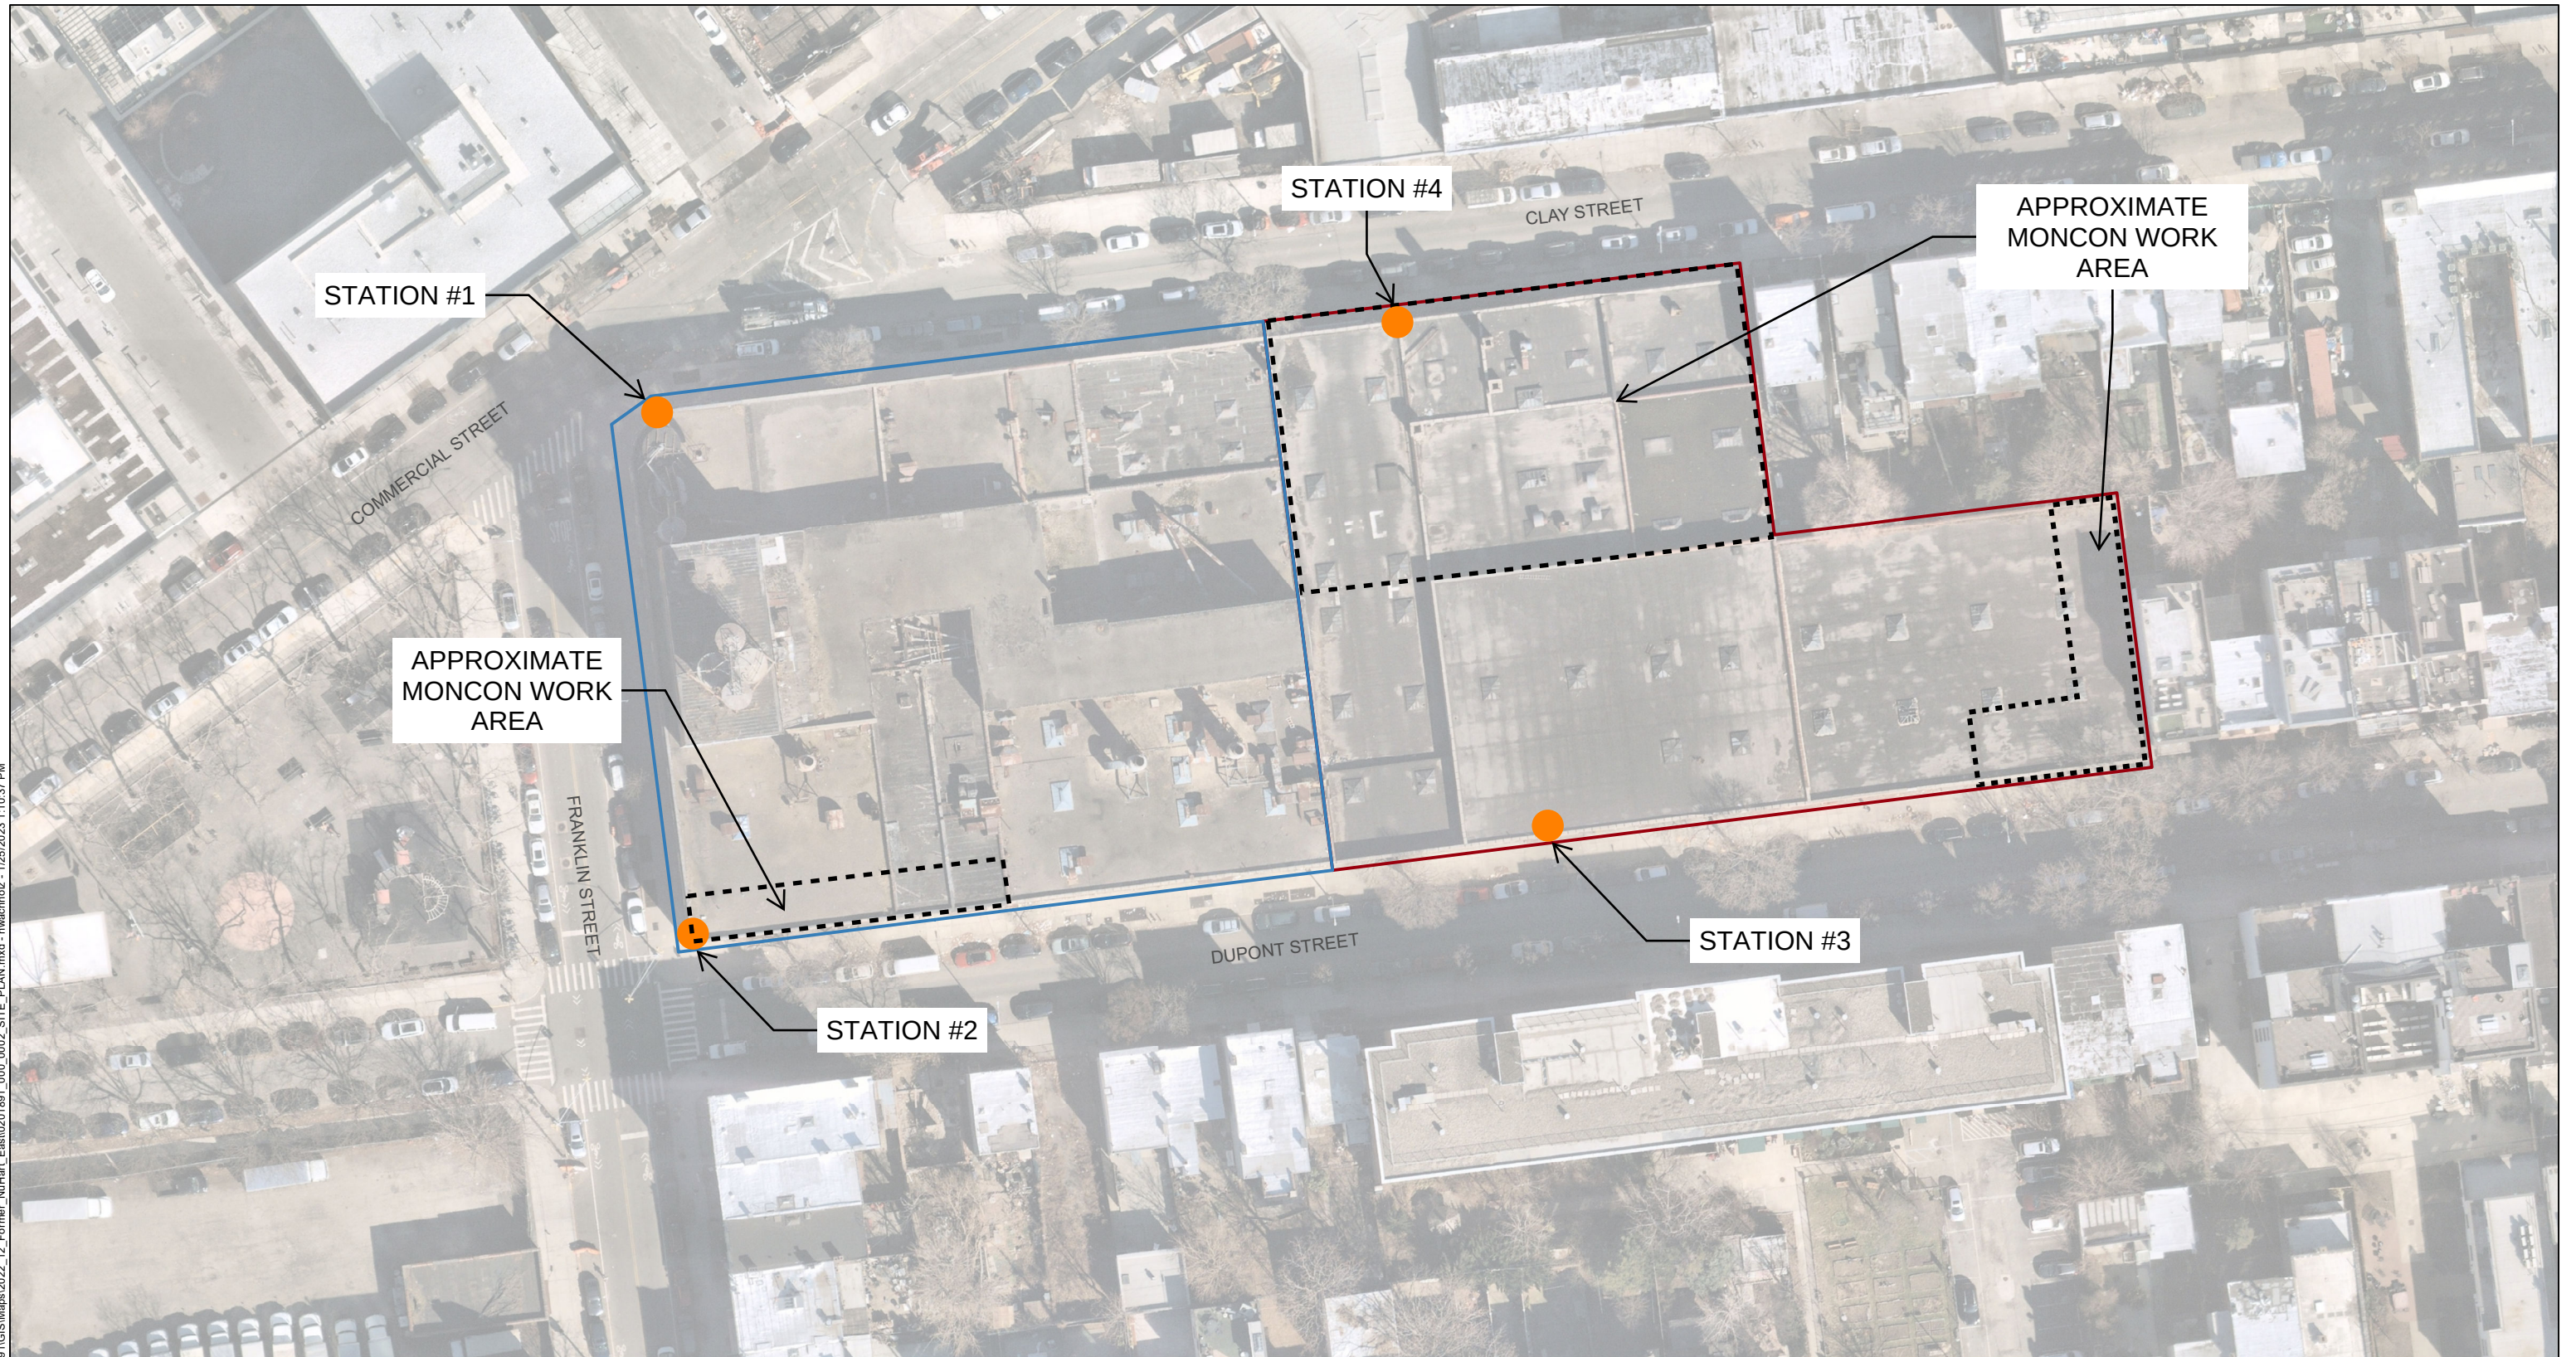

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-03-31

On-Site (OU-1) Work Activities

Personnel : S. SotomayorWeather : 42 to 50°F, SunnyHumidity : 54%Wind Direction : NW to SEParticulate Background (mg/m³) : 0.020PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:15	0.020	0.013	0.026	0.090	0.0	0.0	0.0	0.0		
07:30	0.019	0.012	0.018	0.044	0.0	0.0	0.0	0.0		
07:45	0.064	0.013	0.014	0.040	0.0	0.0	0.0	0.0		
08:00	0.028	0.017	0.013	0.034	0.0	0.7	0.0	0.0		
08:15	0.019	0.012	0.012	0.033	0.0	0.1	0.0	0.0		
08:30	0.016	0.014	0.013	0.034	0.0	0.0	0.0	0.0		
08:45	0.017	0.012	0.012	0.035	0.0	0.0	0.0	0.0		
09:00	0.018	0.012	0.011	0.035	0.0	0.0	0.0	0.0		
09:15	0.017	0.014	0.012	0.033	0.0	0.0	0.0	0.0		
09:30	0.015	0.011	0.011	0.032	0.0	0.0	0.0	0.0		
09:45	0.014	0.011	0.011	0.032	0.0	0.0	0.0	0.0		
10:00	0.015	0.011	0.011	0.034	0.0	0.0	0.0	0.0		
10:15	0.013	0.011	0.011	0.040	0.0	0.0	0.0	0.0		
10:30	0.013	0.011	0.010	0.035	0.0	0.0	0.0	0.0		
10:45	0.012	0.011	0.011	0.034	0.0	0.0	0.0	0.0		
11:00	0.013	0.011	0.012	0.034	0.0	0.0	0.0	0.0		
11:15	0.022	0.012	0.017	0.036	0.0	0.0	0.0	0.0		
11:30	0.017	0.012	0.012	0.033	0.0	0.0	0.0	0.0		
11:45	0.016	0.011	0.012	0.035	0.0	0.0	0.0	0.0		
12:00	0.015	0.011	0.012	0.032	0.0	0.0	0.0	0.0		
12:15	0.016	0.011	0.014	0.032	0.0	0.0	0.1	0.0		
12:30	0.018	0.011	0.012	0.032	0.0	0.0	0.0	0.0		
12:45	0.020	0.010	0.012	0.031	0.0	0.0	0.0	0.0		
13:00	0.020	0.010	0.013	0.030	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.013	0.011	0.010	0.036	0.0	0.0	0.0	0.0		
13:30	0.014	0.010	0.010	0.035	0.0	0.0	0.0	0.0		
13:45	0.014	0.010	0.011	0.034	0.0	0.0	0.0	0.0		
14:00	0.015	0.012	0.016	0.038	0.0	0.0	0.0	0.0		
14:15	0.014	0.010	0.013	0.034	0.0	0.0	0.0	0.0		
14:30	0.013	0.010	0.013	0.033	0.0	0.0	0.0	0.0		
14:45	0.016	0.010	0.014	0.032	0.0	0.0	0.0	0.0		
15:00	0.013	0.011	0.012	0.031	0.0	0.0	0.0	0.0		
15:15	0.014	0.011	0.011	0.031	0.0	0.0	0.0	0.0		
15:30	0.013	0.010	0.011	0.030	0.0	0.0	0.0	0.0		
15:45	0.013	0.010	0.010	0.031	0.0	0.0	0.0	0.0		
16:00	0.012	0.009	0.009	0.030	0.0	0.0	0.0	0.0		
16:15	0.012	0.010	0.011	0.030	0.0	0.0	0.0	0.0		
16:30	0.013	0.011	0.012	0.032	0.0	0.0	0.0	0.0		
16:45	0.014	0.010	0.013	0.035	0.0	0.0	0.0	0.0		
17:00	0.018	0.011	0.009	0.031	0.0	0.0	0.0	0.0		
17:15	0.014	0.010	0.010	0.031	0.0	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	163
NYSDEC Site	NYSDEC Site 224136	Date	4/1/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	48-71°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering	Wind Direction	From SW to NE up to 12 mph
Weather	Rain	Personnel on Site	M. Boland
Humidity	91%	Time on Site	9:00am to 4:45pm

Haley & Aldrich of New York (Haley & Aldrich) was present observe the contractor drilling through obstructions along the southwest portion of the site, and to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. LNAPL detected in MW-24 at 14.05 ft and water detected at 14.08 ft. Approximately 0.88 gallons of LNAPL recovered to date. Oil absorbent sock temporarily installed in MW-24.
- Contractor drilling through obstructions inhibiting sheet pile installation along southwest portion of the site.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ													Totals:
Today:	0 load	0 tons												
Total:	15 loads	180 tons												

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 9:15 am to 4:30 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.


Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of obstruction clearing for sheet pile installation, facing northeast.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Map\2022_12_Former_Nuhart_East\20210891_000_0002_SITE_PLAN.mxd - hwalcholz - 1/25/2023 1:10:37 PM

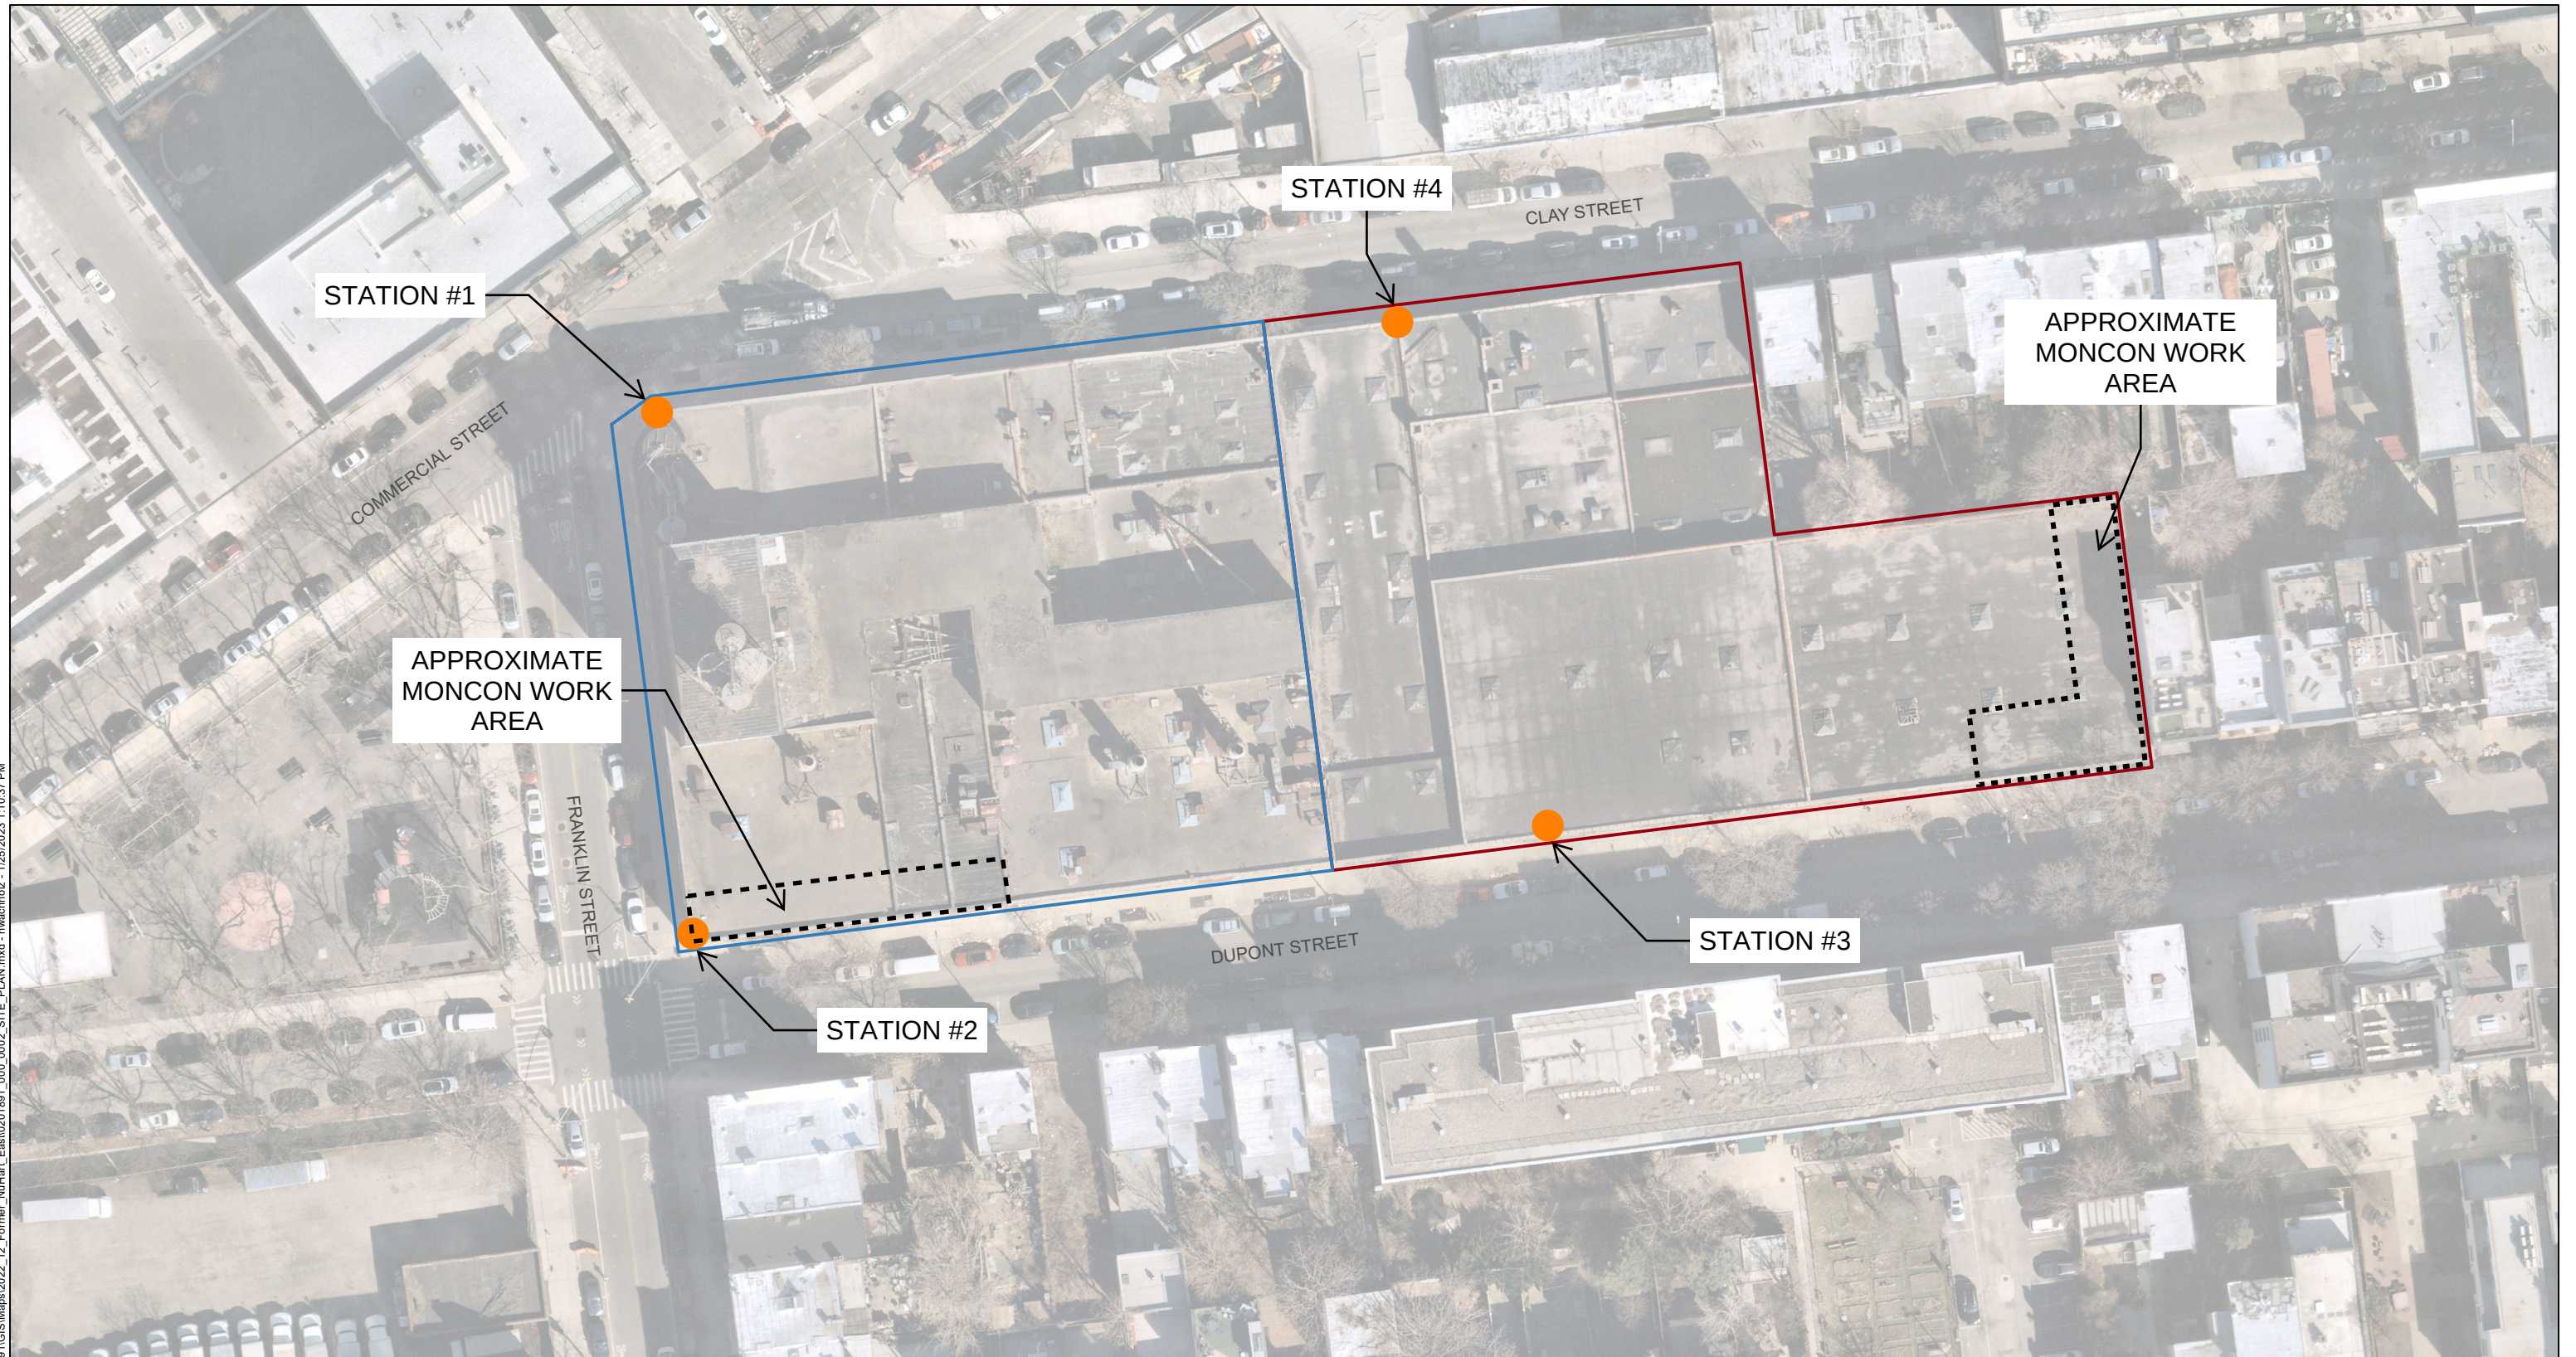

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

APRIL 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-04-01

On-Site (OU-1) Work Activities

Personnel : M. BolandWeather : 48 to 71°F, RainHumidity : 91%Wind Direction : SW to NEParticulate Background (mg/m³) : 0.014PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
09:15	0.019	0.014	0.018	0.041	0.0	0.0	0.0	0.0		
09:30	0.014	0.012	0.013	0.034	0.0	0.0	0.0	0.0		
09:45	0.012	0.012	0.012	0.032	0.0	0.0	0.0	0.0		
10:00	0.012	0.012	0.014	0.032	0.0	0.0	0.0	0.0		
10:15	0.012	0.011	0.012	0.032	0.0	0.0	0.0	0.0		
10:30	0.013	0.011	0.014	0.033	0.0	0.0	0.0	0.0		
10:45	0.013	0.012	0.015	0.033	0.0	0.0	0.0	0.0		
11:00	0.010	0.010	0.011	0.030	0.0	0.0	0.0	0.0		
11:15	0.008	0.009	0.007	0.028	0.0	0.0	0.0	0.0		
11:30	0.008	0.009	0.009	0.028	0.0	0.0	0.0	0.0		
11:45	0.008	0.009	0.008	0.027	0.0	0.0	0.0	0.0		
12:00	0.008	0.008	0.007	0.027	0.0	0.0	0.0	0.0		
12:15	0.008	0.008	0.007	0.027	0.0	0.0	0.0	0.0		
12:30	0.008	0.008	0.012	0.027	0.0	0.0	0.0	0.0		
12:45	0.007	0.009	0.007	0.027	0.0	0.0	0.0	0.0		
13:00	0.008	0.008	0.006	0.027	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.008	0.009	0.006	0.027	0.0	0.0	0.0	0.0		
13:30	0.007	0.009	0.007	0.027	0.0	0.0	0.0	0.0		
13:45	0.007	0.010	0.007	0.027	0.0	0.0	0.0	0.0		
14:00	0.008	0.009	0.008	0.027	0.0	0.0	0.0	0.0		
14:15	0.008	0.010	0.007	0.026	0.0	0.0	0.0	0.0		
14:30	0.007	0.010	0.006	0.026	0.0	0.0	0.0	0.0		
14:45	0.008	0.009	0.009	0.025	0.0	0.1	0.0	0.0		
15:00	0.007	0.009	0.011	0.025	0.0	0.1	0.0	0.0		
15:15	0.007	0.010	0.006	0.025	0.0	0.1	0.0	0.0		
15:30	0.008	0.009	0.006	0.025	0.0	0.0	0.0	0.0		
15:45	0.008	0.009	0.006	0.025	0.0	0.0	0.0	0.0		
16:00	0.008	0.010	0.006	0.025	0.0	0.0	0.0	0.0		
16:15	0.007	0.009	0.006	0.024	0.0	0.0	0.0	0.0		
16:30	0.007	0.009	0.006	0.024	0.0	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	164
NYSDEC Site	NYSDEC Site 224136	Date	4/3/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	43-52°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc., JZN Engineering	Wind Direction	From NE to SW up to 12 mph
Weather	Rain	Personnel on Site	S. Sotomayor
Humidity	38%	Time on Site	7:00am to 5:30pm

Haley & Aldrich of New York (Haley & Aldrich) was present observe the contractor drilling through obstructions along the southwest portion of the site, and to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor drilling through obstructions inhibiting sheet pile installation along southwest portion of the site.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ												Totals:
Today:	0 load	0 tons											
Total:	<u>15</u> loads	<u>180</u> tons											

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:00 am to 5:30 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.


Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of obstruction clearing for sheet pile installation, facing northwest.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Map\2022_12_Former_Nuhart_East\20210891_000_0002_SITE_PLAN.mxd - hwalcholz - 1/25/2023 1:10:37 PM

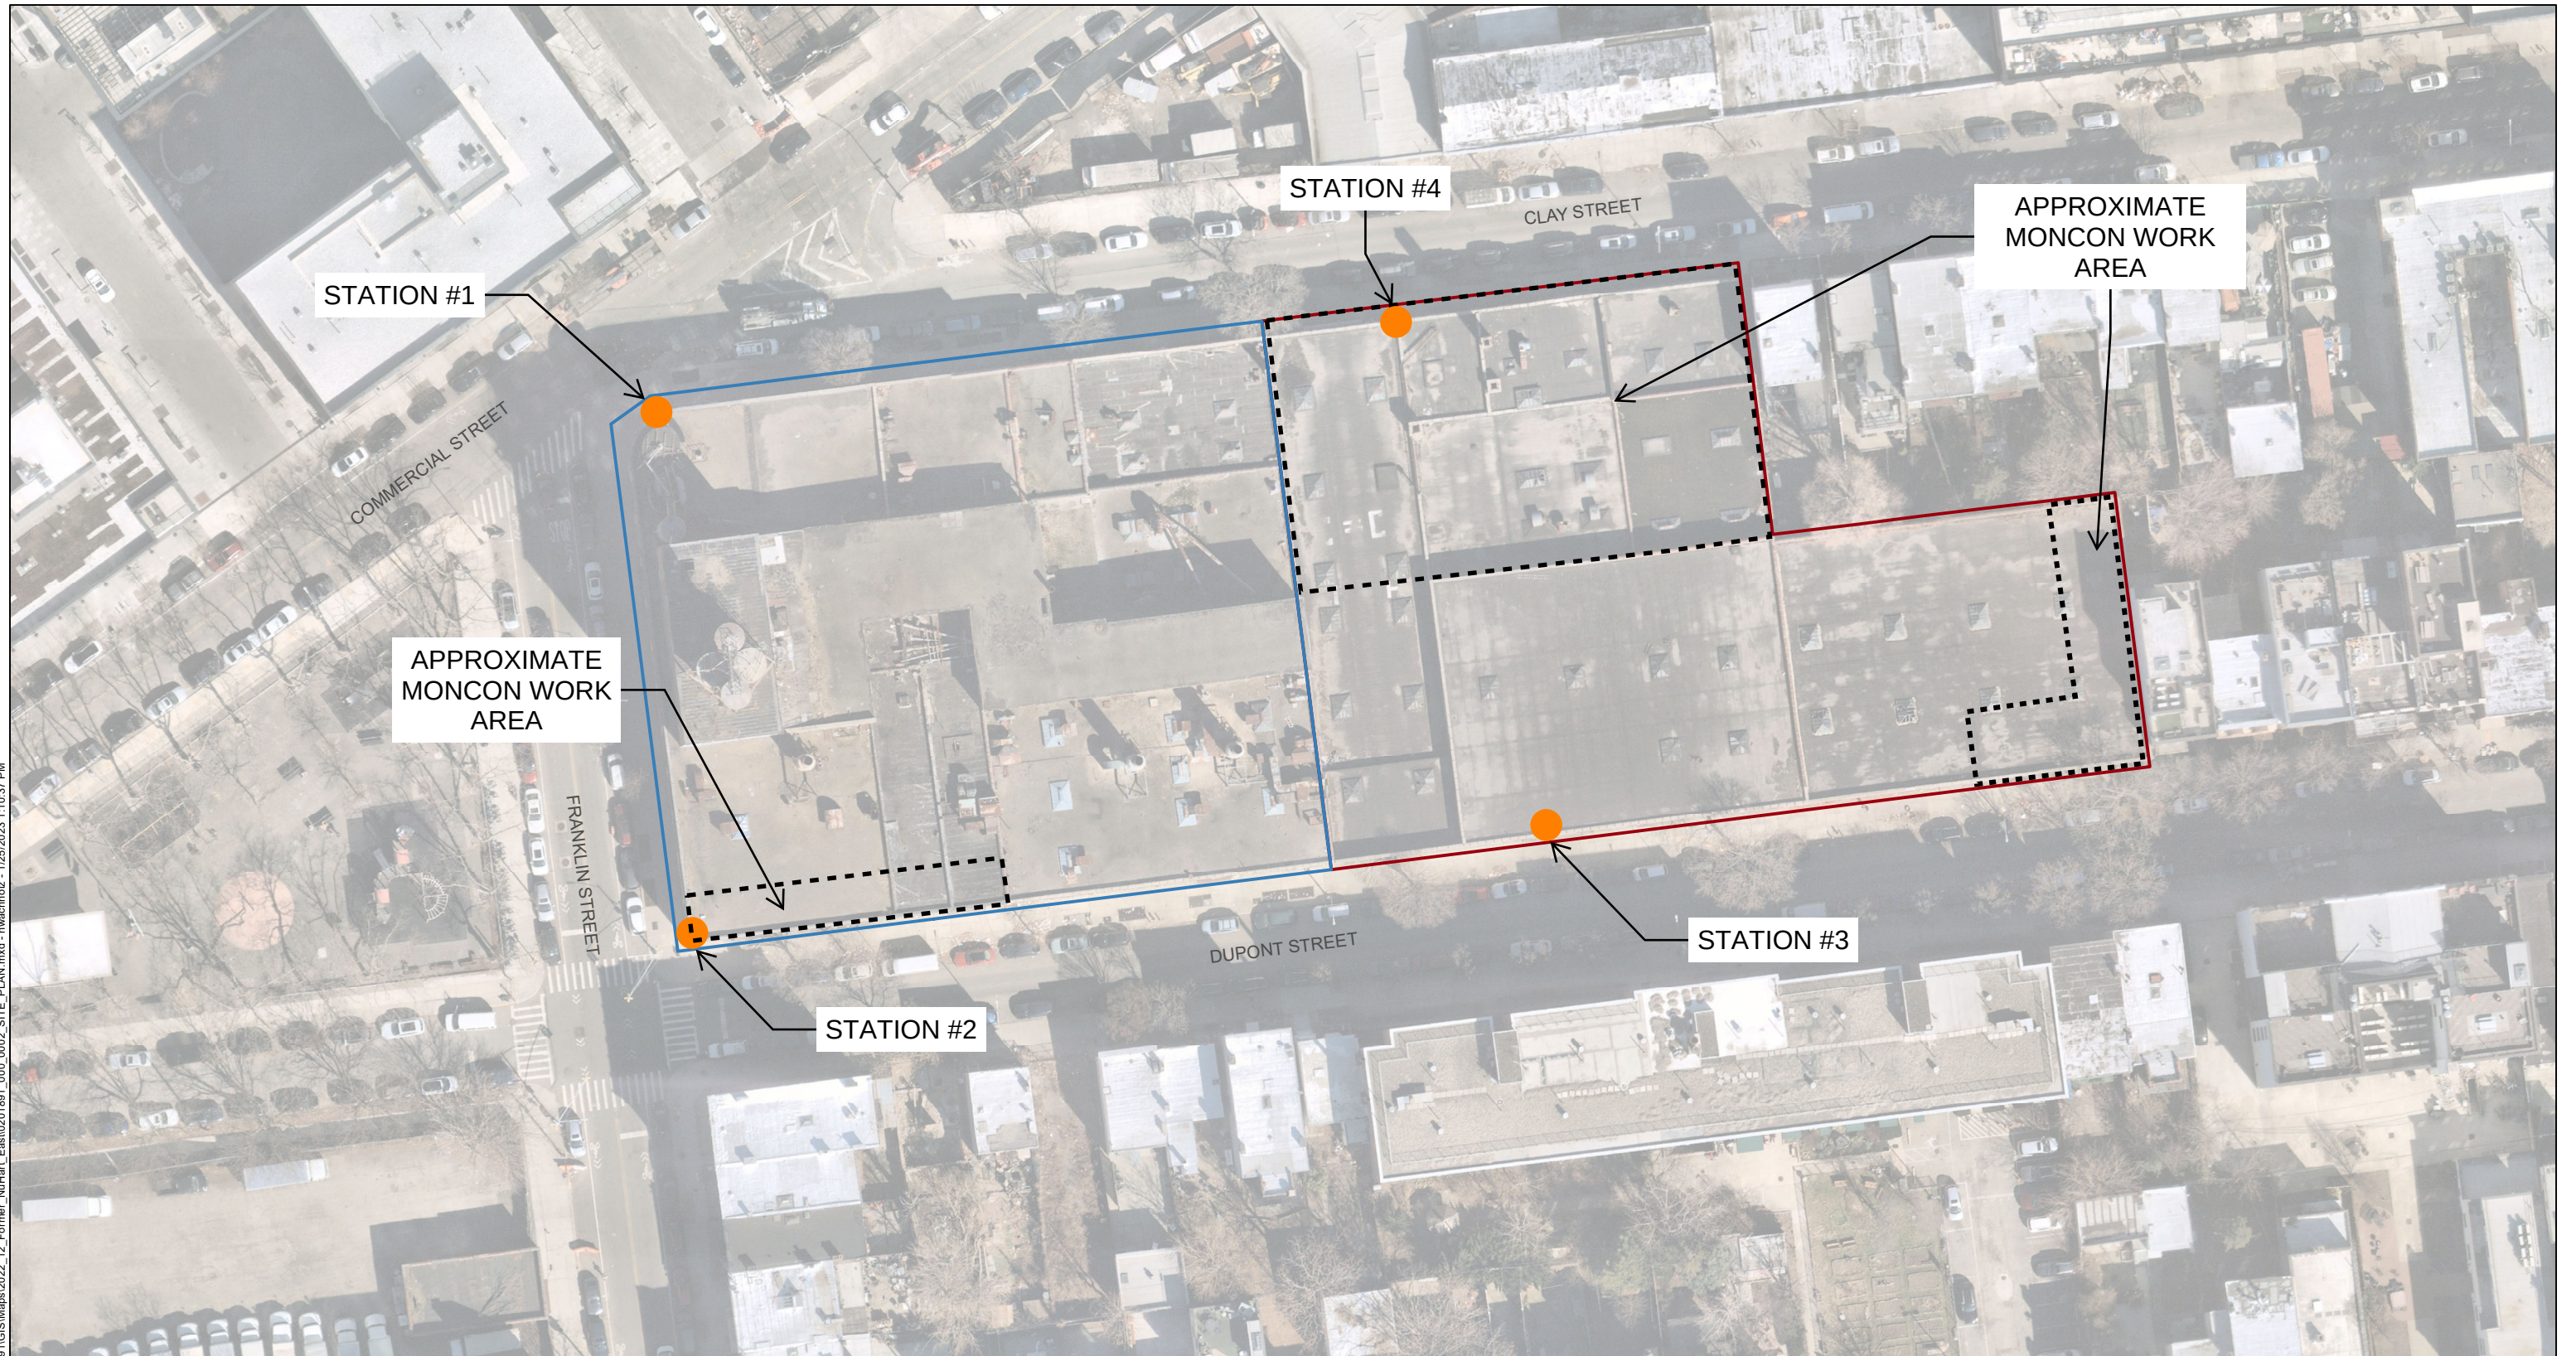

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

MARCH 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-04-03

On-Site (OU-1) Work Activities

Personnel : S. SotomayorWeather : 43-52°F, SunnyHumidity : 38%Wind Direction : NE to SWParticulate Background (mg/m³) : 0.028PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00		0.028	0.042			0.0	0.0			
07:15	0.034	0.023	0.035	0.051	0.0	0.0	0.0	0.0		
07:30	0.013	0.011	0.012	0.032	0.0	0.0	0.0	0.0		
07:45	0.011	0.011	0.010	0.030	0.0	0.0	0.0	0.0		
08:00	0.009	0.011	0.009	0.029	0.0	0.0	0.0	0.0		
08:15	0.010	0.011	0.009	0.031	0.0	0.0	0.0	0.0		
08:30	0.009	0.010	0.009	0.030	0.0	0.0	0.0	0.0		
08:45	0.010	0.011	0.008	0.030	0.0	0.0	0.0	0.0		
09:00	0.008	0.009	0.008	0.029	0.0	0.0	0.0	0.0		
09:15	0.009	0.010	0.007	0.029	0.0	0.0	0.0	0.0		
09:30	0.008	0.009	0.008	0.029	0.0	0.0	0.0	0.0		
09:45	0.007	0.008	0.008	0.028	0.0	0.0	0.0	0.0		
10:00	0.008	0.009	0.007	0.028	0.0	0.0	0.0	0.0		
10:15	0.007	0.010	0.007	0.027	0.0	0.0	0.0	0.0		
10:30	0.008	0.009	0.007	0.028	0.0	0.0	0.0	0.0		
10:45	0.007	0.009	0.007	0.028	0.0	0.0	0.0	0.0		
11:00	0.007	0.009	0.008	0.029	0.0	0.0	0.0	0.0		
11:15	0.008	0.009	0.009	0.028	0.0	0.0	0.0	0.0		
11:30	0.008	0.009	0.009	0.029	0.0	0.0	0.0	0.0		
11:45	0.007	0.010	0.009	0.028	0.0	0.0	0.0	0.0		
12:00	0.008	0.009	0.008	0.027	0.0	0.0	0.0	0.0		
12:15	0.007	0.009	0.010	0.027	0.0	0.0	0.0	0.0		
12:30	0.007	0.009	0.009	0.027	0.0	0.0	0.0	0.0		
12:45	0.007	0.009	0.007	0.028	0.0	0.0	0.0	0.0		
13:00	0.007	0.008	0.008	0.026	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.008	0.010	0.009	0.027	0.0	0.0	0.0	0.0		
13:30	0.009	0.010	0.013	0.028	0.0	0.0	0.0	0.0		
13:45	0.008	0.009	0.011	0.027	0.0	0.0	0.0	0.0		
14:00	0.008	0.010	0.013	0.027	0.0	0.0	0.0	0.0		
14:15	0.009	0.010	0.011	0.027	0.0	0.0	0.0	0.0		
14:30	0.010	0.009	0.011	0.028	0.0	0.0	0.0	0.0		
14:45	0.011	0.010	0.010	0.028	0.0	0.0	0.0	0.0		
15:00	0.010	0.010	0.013	0.030	0.0	0.0	0.0	0.0		
15:15	0.011	0.011	0.013	0.032	0.0	0.0	0.0	0.0		
15:30	0.010	0.011	0.010	0.030	0.0	0.0	0.0	0.0		
15:45	0.013	0.010	0.011	0.032	0.0	0.0	0.0	0.0		
16:00	0.016	0.010	0.016	0.033	0.0	0.0	0.0	0.0		
16:15	0.017	0.010	0.011	0.032	0.0	0.0	0.0	0.0		
16:30	0.022	0.010	0.011	0.032	0.0	0.0	0.0	0.0		
16:45	0.018	0.010	0.009	0.030	0.0	0.0	0.0	0.0		
17:00	0.016	0.010	0.011	0.031	0.0	0.0	0.0	0.0		
17:15	0.014	0.010	0.010	0.030	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Material Export:

- | | | | | | | | | | |
|--------|--------------------------------|-------------|--|--|--|--|--|--|---------|
| | Clean Earth of
Carteret, NJ | | | | | | | | Totals: |
| Today: | 0
load | 0
tons | | | | | | | |
| Total: | 15
loads | 180
tons | | | | | | | |

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

- None


Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:15 am to 5:45 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of site, facing northwest.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Map\2022_12_Former_Nuhart_East\20210891_000_0002_SITE_PLAN.mxd - hwalcholz - 1/25/2023 1:10:37 PM

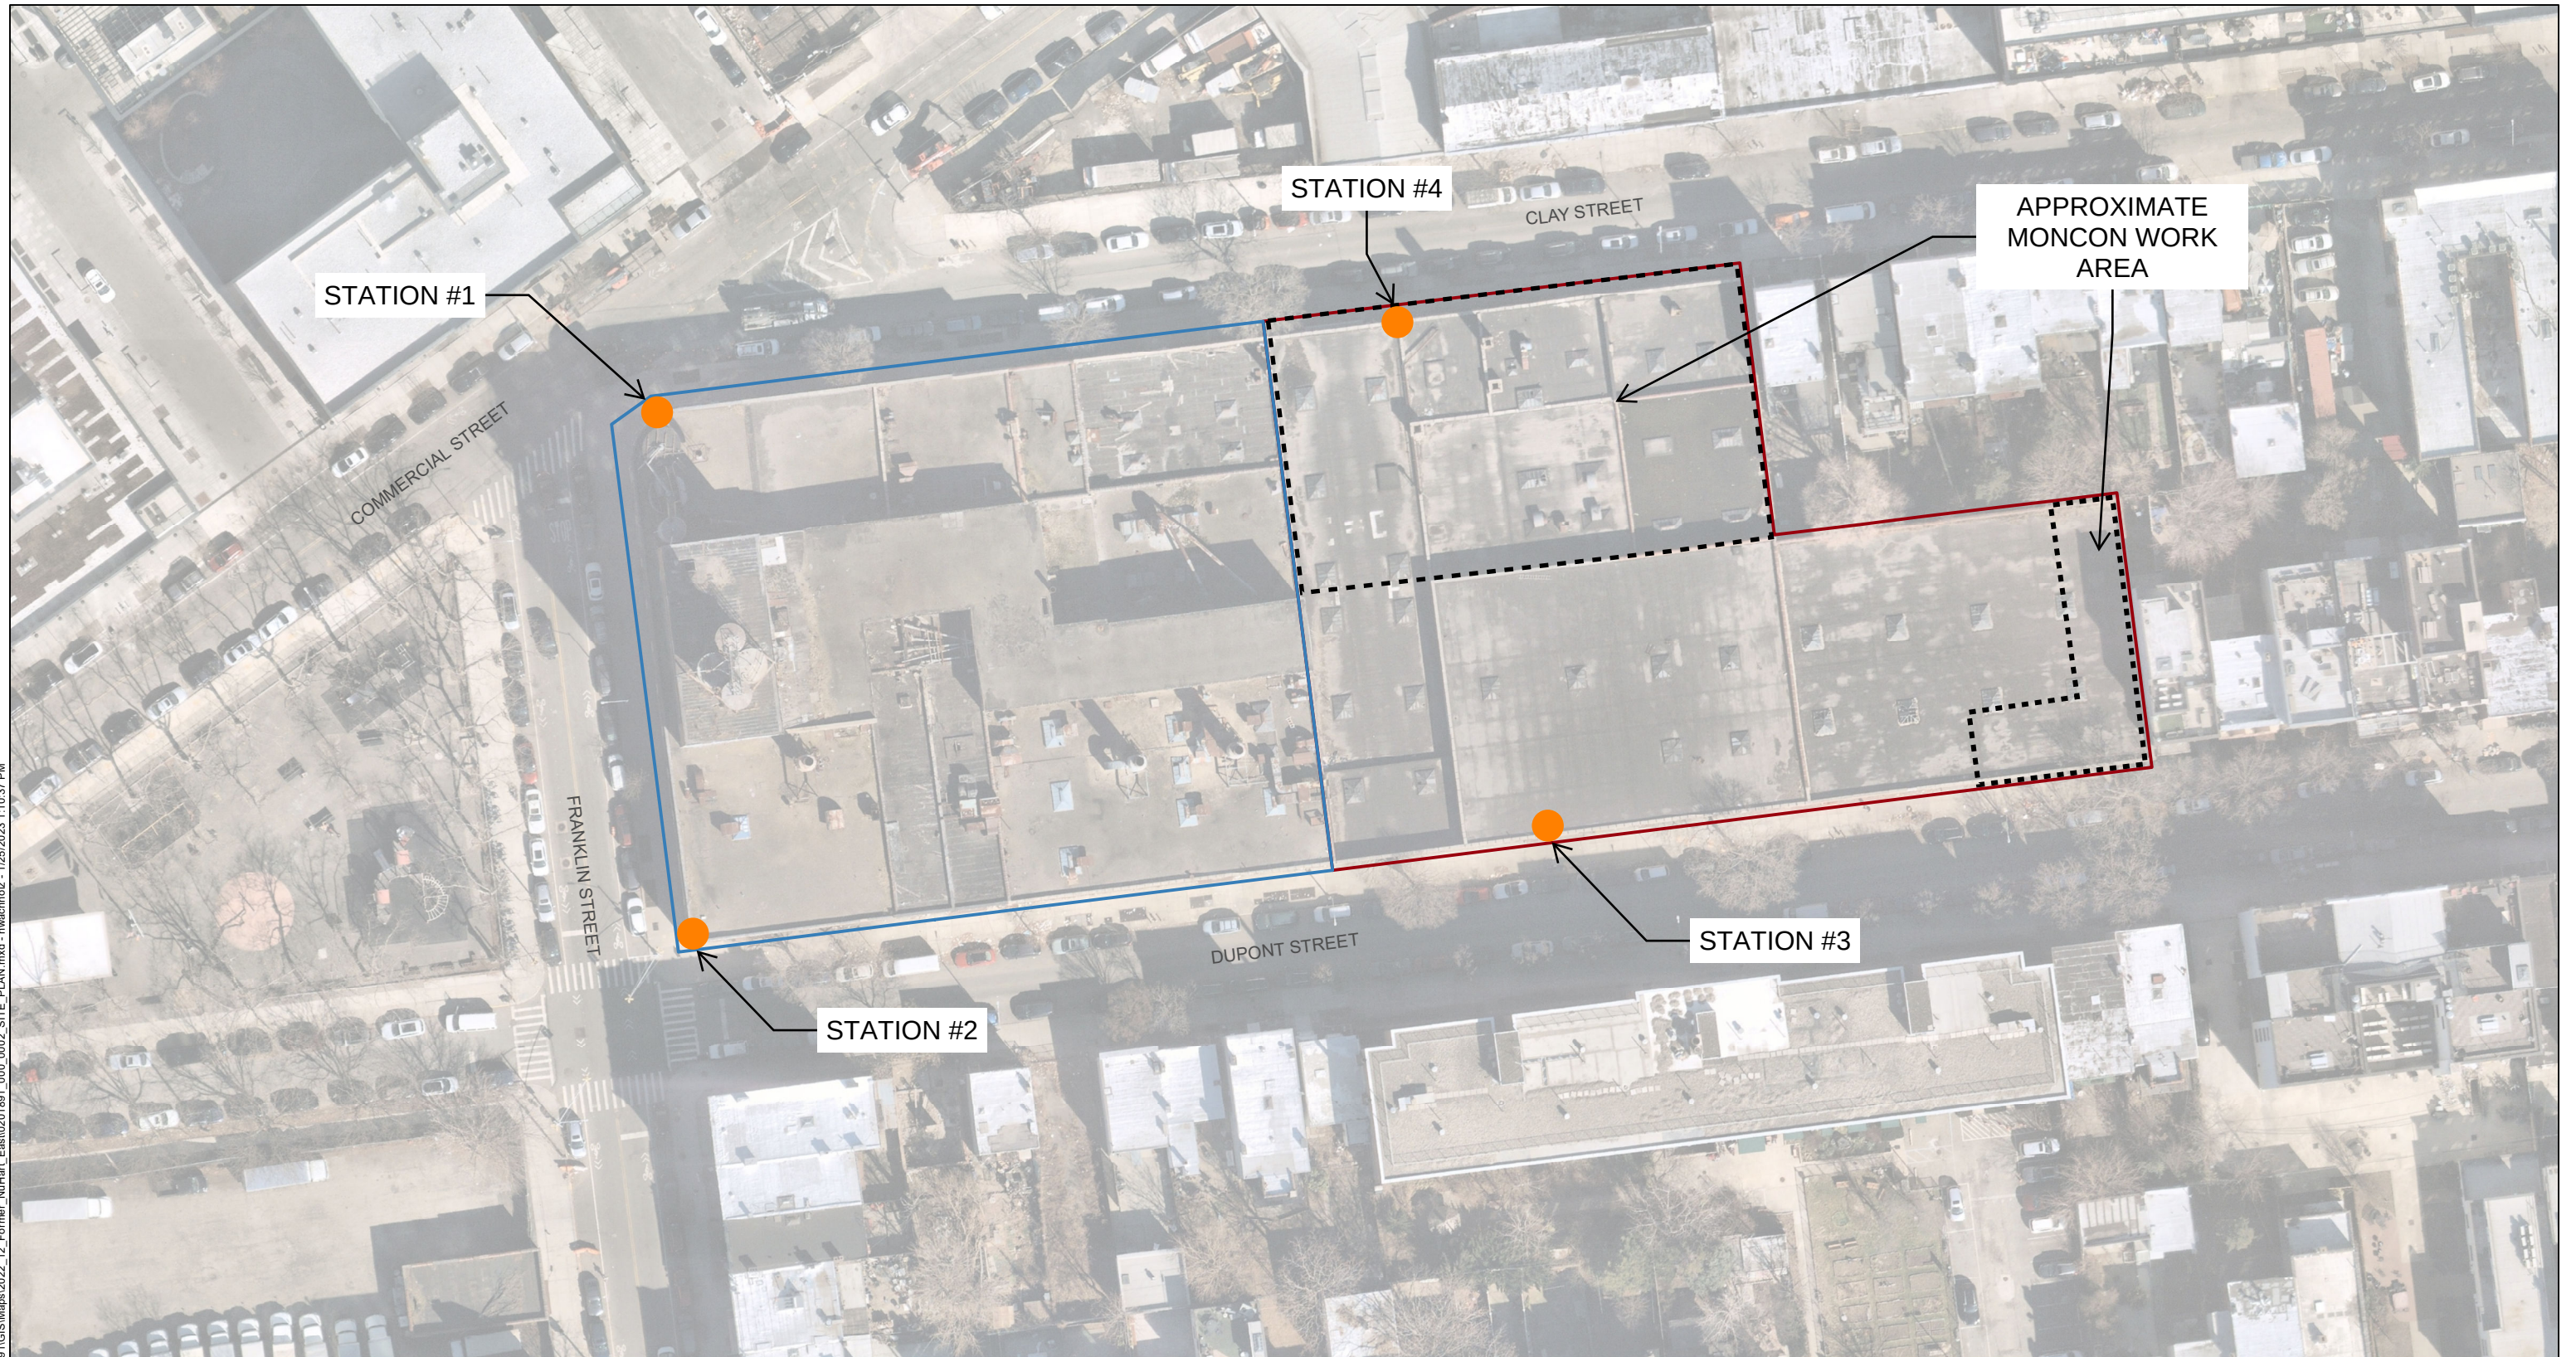

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

APRIL 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-04-04

On-Site (OU-1) Work Activities

Personnel : S. Sotomayor
 Weather : 52 to 60°F, Sunny
 Humidity : 89%
 Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.020PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:15	0.029	0.020	0.022	0.050	0.0	0.0	0.0	0.1		
07:30	0.023	0.018	0.021	0.042	0.0	0.0	0.0	0.1		
07:45	0.024	0.017	0.018	0.040	0.0	0.0	0.0	0.0		
08:00	0.026	0.017	0.018	0.040	0.0	0.0	0.0	0.0		
08:15	0.032	0.022	0.028	0.046	0.0	0.0	0.0	0.0		
08:30	0.031	0.023	0.027	0.046	0.0	0.0	0.0	0.0		
08:45	0.030	0.020	0.025	0.045	0.0	0.0	0.0	0.0		
09:00	0.025	0.020	0.022	0.043	0.0	0.0	0.0	0.0		
09:15	0.021	0.017	0.021	0.040	0.0	0.0	0.0	0.0		
09:30	0.021	0.016	0.021	0.040	0.0	0.0	0.0	0.0		
09:45	0.022	0.017	0.021	0.040	0.0	0.0	0.0	0.0		
10:00	0.022	0.016	0.021	0.039	0.0	0.0	0.0	0.0		
10:15	0.018	0.014	0.016	0.034	0.0	0.0	0.0	0.0		
10:30	0.014	0.013	0.014	0.032	0.0	0.0	0.0	0.0		
10:45	0.014	0.013	0.015	0.032	0.0	0.0	0.0	0.0		
11:00	0.013	0.013	0.014	0.031	0.0	0.0	0.0	0.0		
11:15	0.013	0.013	0.014	0.032	0.0	0.0	0.0	0.0		
11:30	0.013	0.012	0.014	0.031	0.0	0.0	0.0	0.0		
11:45	0.013	0.012	0.013	0.030	0.0	0.0	0.0	0.0		
12:00	0.012	0.011	0.013	0.030	0.0	0.0	0.0	0.0		
12:15	0.012	0.011	0.011	0.029	0.0	0.0	0.0	0.0		
12:30	0.011	0.011	0.011	0.029	0.0	0.0	0.0	0.1		
12:45	0.011	0.010	0.010	0.029	0.0	0.0	0.0	0.0		
13:00	0.011	0.011	0.011	0.029	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.014	0.012	0.013	0.031	0.0	0.0	0.0	0.0		
13:30	0.015	0.012	0.014	0.032	0.0	0.0	0.0	0.0		
13:45	0.014	0.011	0.012	0.032	0.0	0.0	0.0	0.0		
14:00	0.013	0.011	0.012	0.031	0.0	0.0	0.0	0.0		
14:15	0.016	0.011	0.012	0.035	0.0	0.0	0.0	0.0		
14:30	0.014	0.011	0.011	0.032	0.0	0.0	0.0	0.0		
14:45	0.014	0.011	0.010	0.029	0.0	0.0	0.0	0.0		
15:00	0.012	0.010	0.010	0.029	0.0	0.0	0.0	0.0		
15:15	0.014	0.011	0.010	0.029	0.0	0.0	0.0	0.0		
15:30	0.013	0.011	0.012	0.029	0.0	0.0	0.0	0.0		
15:45	0.013	0.011	0.011	0.029	0.0	0.0	0.0	0.0		
16:00	0.013	0.011	0.010	0.029	0.0	0.0	0.0	0.0		
16:15	0.012	0.011	0.010	0.029	0.0	0.0	0.0	0.0		
16:30	0.011	0.010	0.010	0.028	0.0	0.0	0.0	0.0		
16:45	0.012	0.010	0.010	0.028	0.0	0.0	0.0	0.0		
17:00	0.011	0.010	0.009	0.028	0.0	0.0	0.0	0.0		
17:15	0.011	0.010	0.009	0.028	0.0	0.0	0.0	0.0		
17:30	0.012	0.010	0.010	0.029	0.0	0.0	0.0	0.0		
17:45	0.013	0.011	0.012	0.029	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

- Soil/Fill disposal is summarized below:

Notes:
Soil from OU-2 only.
Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:15 am to 5:30 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.


- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:



Photo 1: View of site conditions, facing south.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\20210891_000_0002_SITE_PLAN.mxd - hwaehob - 1/25/2023 1:10:37 PM

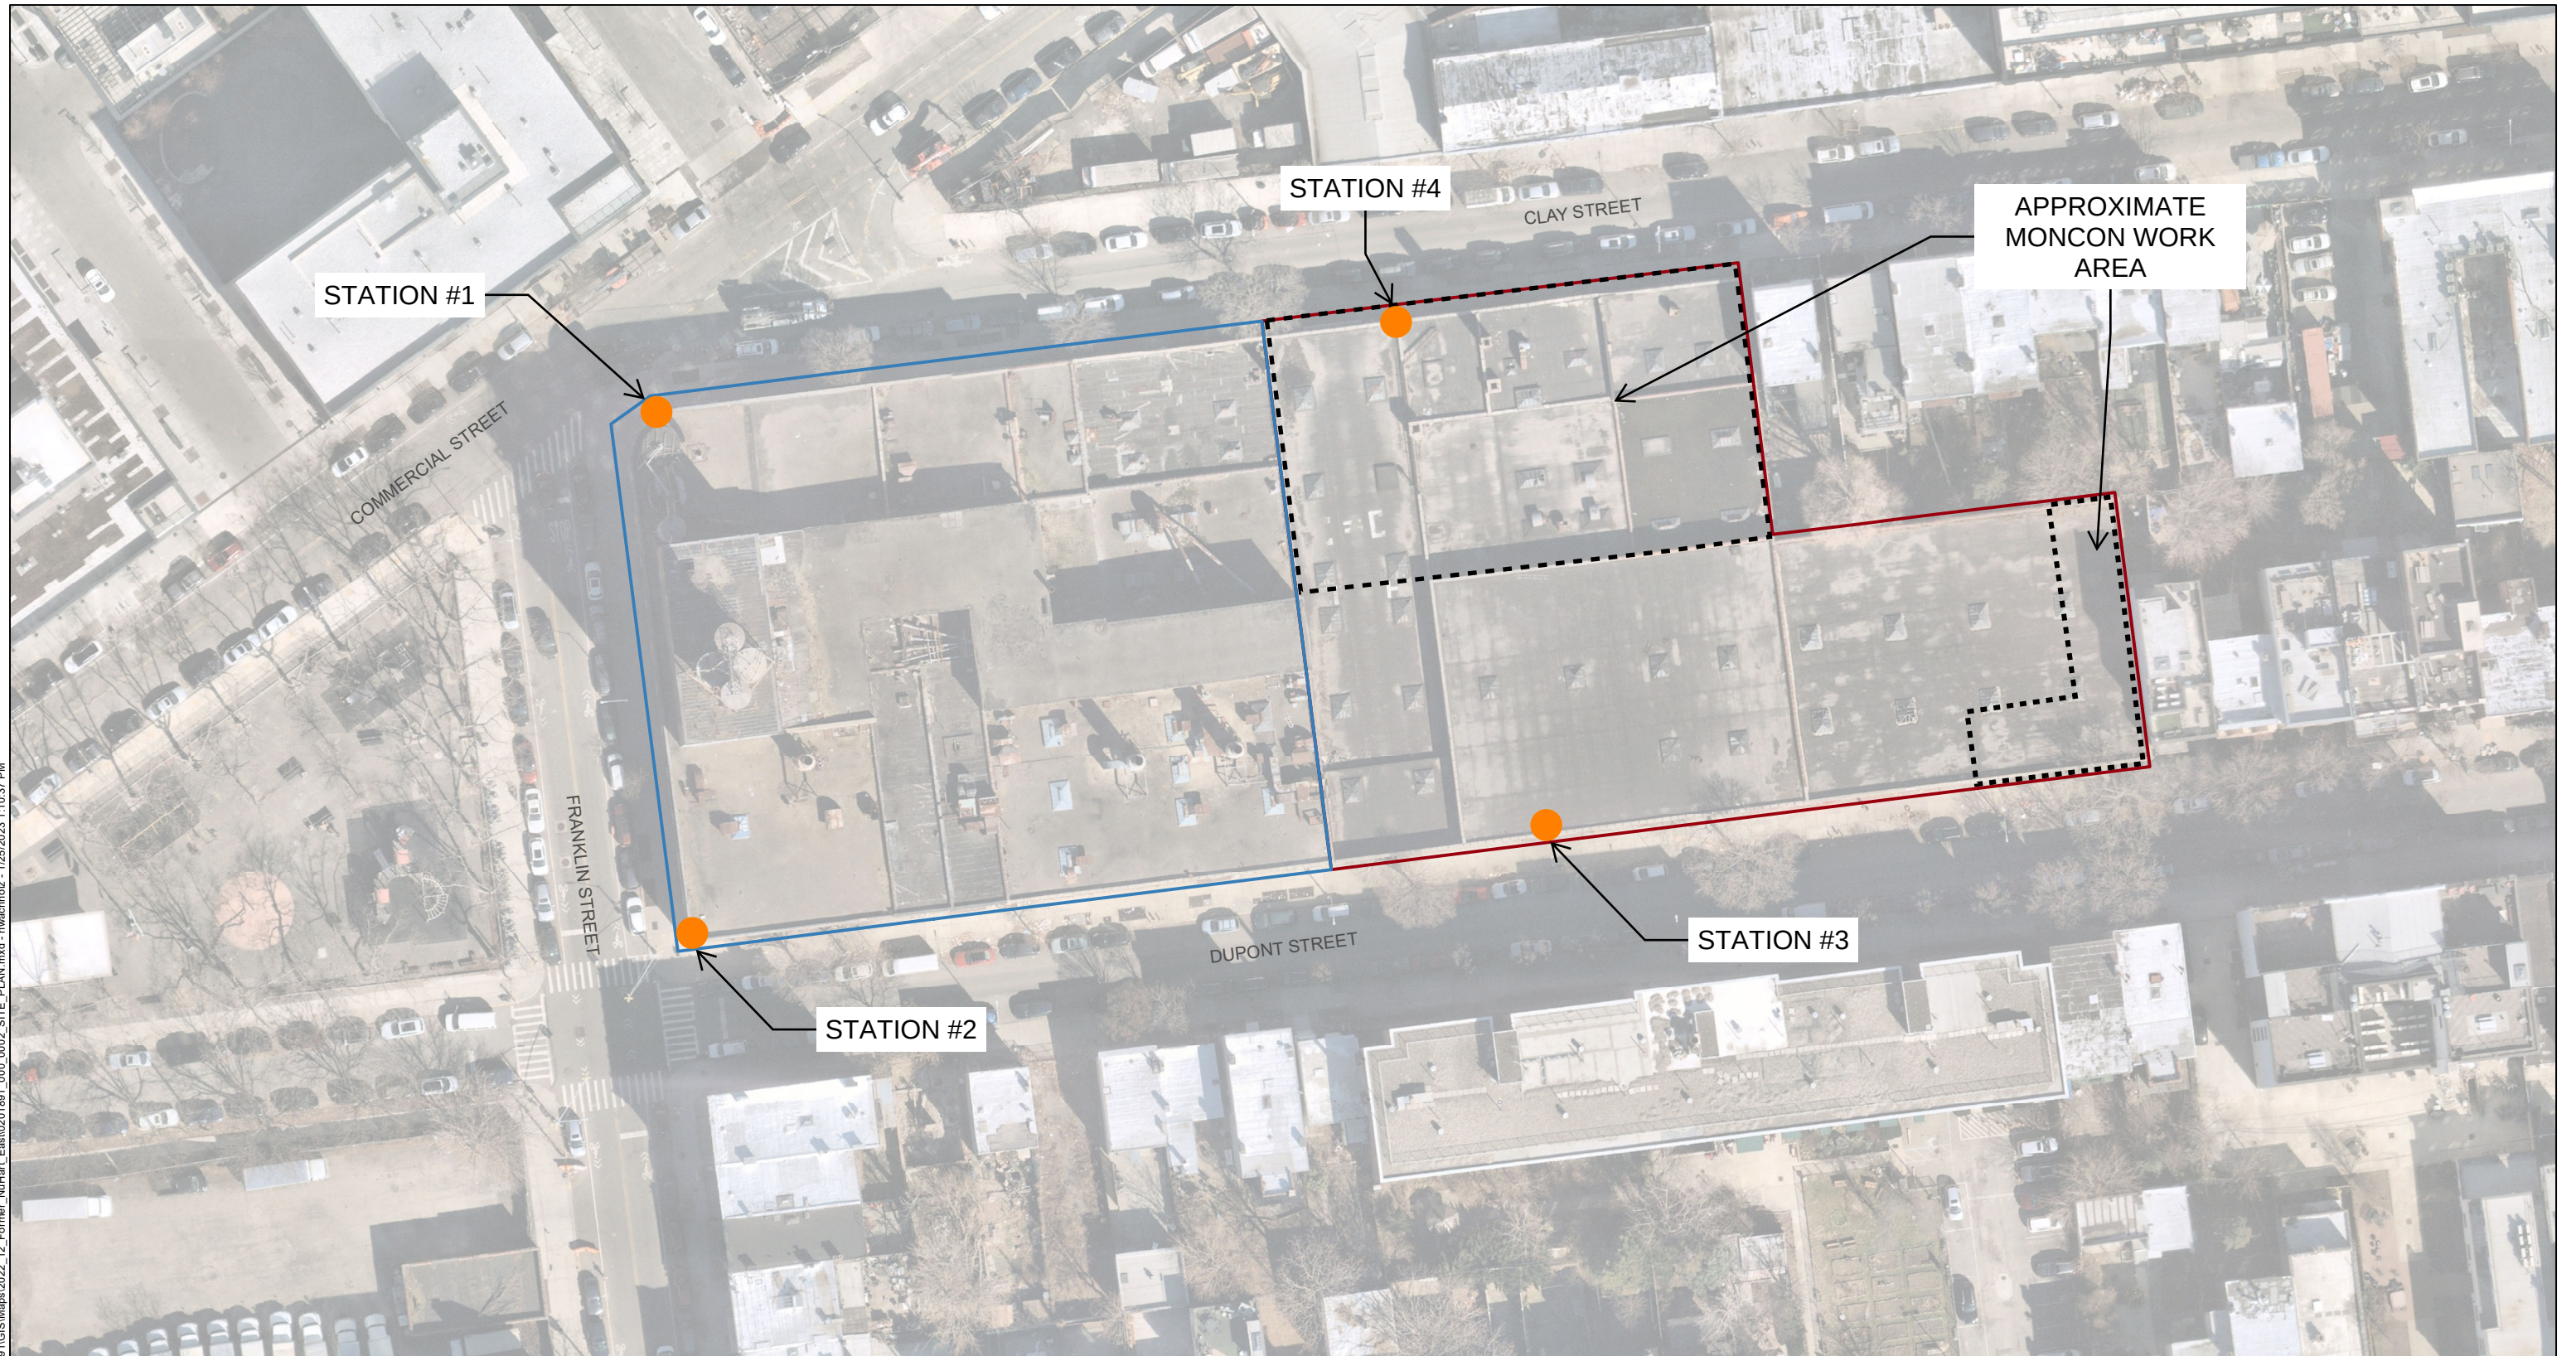

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

APRIL 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-04-05

On-Site (OU-1) Work Activities

Personnel : S. SotomayorWeather : 50 to 52°F, CloudyHumidity : 87%Wind Direction : NE to SWParticulate Background (mg/m³) : 0.012PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:15	0.014	0.012	0.012	0.035	0.0	0.0	0.0	0.0		
07:30	0.012	0.012	0.010	0.032	0.0	0.0	0.0	0.0		
07:45	0.015	0.012	0.010	0.031	0.0	0.0	0.0	0.0		
08:00	0.013	0.012	0.010	0.032	0.0	0.0	0.0	0.0		
08:15	0.011	0.012	0.011	0.032	0.0	0.0	0.0	0.0		
08:30	0.013	0.012	0.011	0.032	0.0	0.0	0.0	0.0		
08:45	0.012	0.013	0.011	0.033	0.0	0.0	0.0	0.0		
09:00	0.013	0.012	0.012	0.033	0.0	0.0	0.0	0.0		
09:15	0.013	0.014	0.012	0.033	0.0	0.0	0.0	0.0		
09:30	0.014	0.015	0.014	0.033	0.0	0.1	0.0	0.0		
09:45	0.014	0.013	0.014	0.033	0.0	0.0	0.0	0.0		
10:00	0.014	0.013	0.013	0.034	0.0	0.0	0.0	0.0		
10:15	0.016	0.013	0.012	0.034	0.0	0.0	0.0	0.0		
10:30	0.018	0.012	0.013	0.034	0.0	0.0	0.0	0.0		
10:45	0.017	0.012	0.012	0.033	0.0	0.1	0.0	0.0		
11:00	0.014	0.013	0.012	0.033	0.0	0.0	0.0	0.0		
11:15	0.013	0.013	0.012	0.032	0.0	0.1	0.0	0.0		
11:30	0.015	0.011	0.011	0.031	0.0	0.0	0.0	0.0		
11:45	0.011	0.010	0.009	0.031	0.0	0.0	0.0	0.0		
12:00	0.011	0.011	0.010	0.031	0.0	0.0	0.0	0.0		
12:15	0.016	0.012	0.011	0.033	0.0	0.0	0.0	0.0		
12:30	0.013	0.012	0.013	0.033	0.0	0.0	0.0	0.0		
12:45	0.012	0.011	0.012	0.032	0.0	0.0	0.0	0.0		
13:00	0.012	0.011	0.012	0.032	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.011	0.011	0.011	0.031	0.0	0.0	0.0	0.0		
13:30	0.013	0.012	0.013	0.032	0.0	0.0	0.0	0.0		
13:45	0.014	0.012	0.012	0.033	0.0	0.0	0.0	0.0		
14:00	0.013	0.012	0.012	0.033	0.0	0.0	0.0	0.0		
14:15	0.013	0.012	0.011	0.033	0.0	0.0	0.0	0.0		
14:30	0.013	0.012	0.012	0.033	0.0	0.0	0.0	0.0		
14:45	0.017	0.012	0.013	0.034	0.0	0.0	0.0	0.0		
15:00	0.015	0.013	0.014	0.034	0.0	0.0	0.0	0.0		
15:15	0.016	0.013	0.014	0.035	0.0	0.0	0.0	0.0		
15:30	0.014	0.012	0.012	0.033	0.0	0.0	0.0	0.0		
15:45	0.014	0.012	0.011	0.032	0.0	0.0	0.0	0.0		
16:00	0.011	0.012	0.010	0.031	0.0	0.0	0.0	0.0		
16:15	0.010	0.010	0.009	0.031	0.0	0.0	0.0	0.0		
16:30	0.011	0.010	0.010	0.031	0.0	0.0	0.0	0.0		
16:45	0.011	0.011	0.010	0.031	0.0	0.0	0.0	0.0		
17:00	0.012	0.011	0.010	0.032	0.0	0.0	0.0	0.0		
17:15	0.011	0.011	0.010	0.031	0.0	0.0	0.0	0.0		
17:30	0.012	0.011	0.010	0.032	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Material Export:

- | | | | | | | | | | |
|--------|--------------------------------|-------------|--|--|--|--|--|--|---------|
| | Clean Earth of
Carteret, NJ | | | | | | | | Totals: |
| Today: | 0
load | 0
tons | | | | | | | |
| Total: | 15
loads | 180
tons | | | | | | | |

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

- None

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:30 am to 4:30 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.


- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:



Photo 1: View of site conditions, facing southwest.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Map\2022_12_Former_Nuhart_East\20210891_000_0002_SITE_PLAN.mxd - hwalchob - 1/25/2023 1:10:37 PM

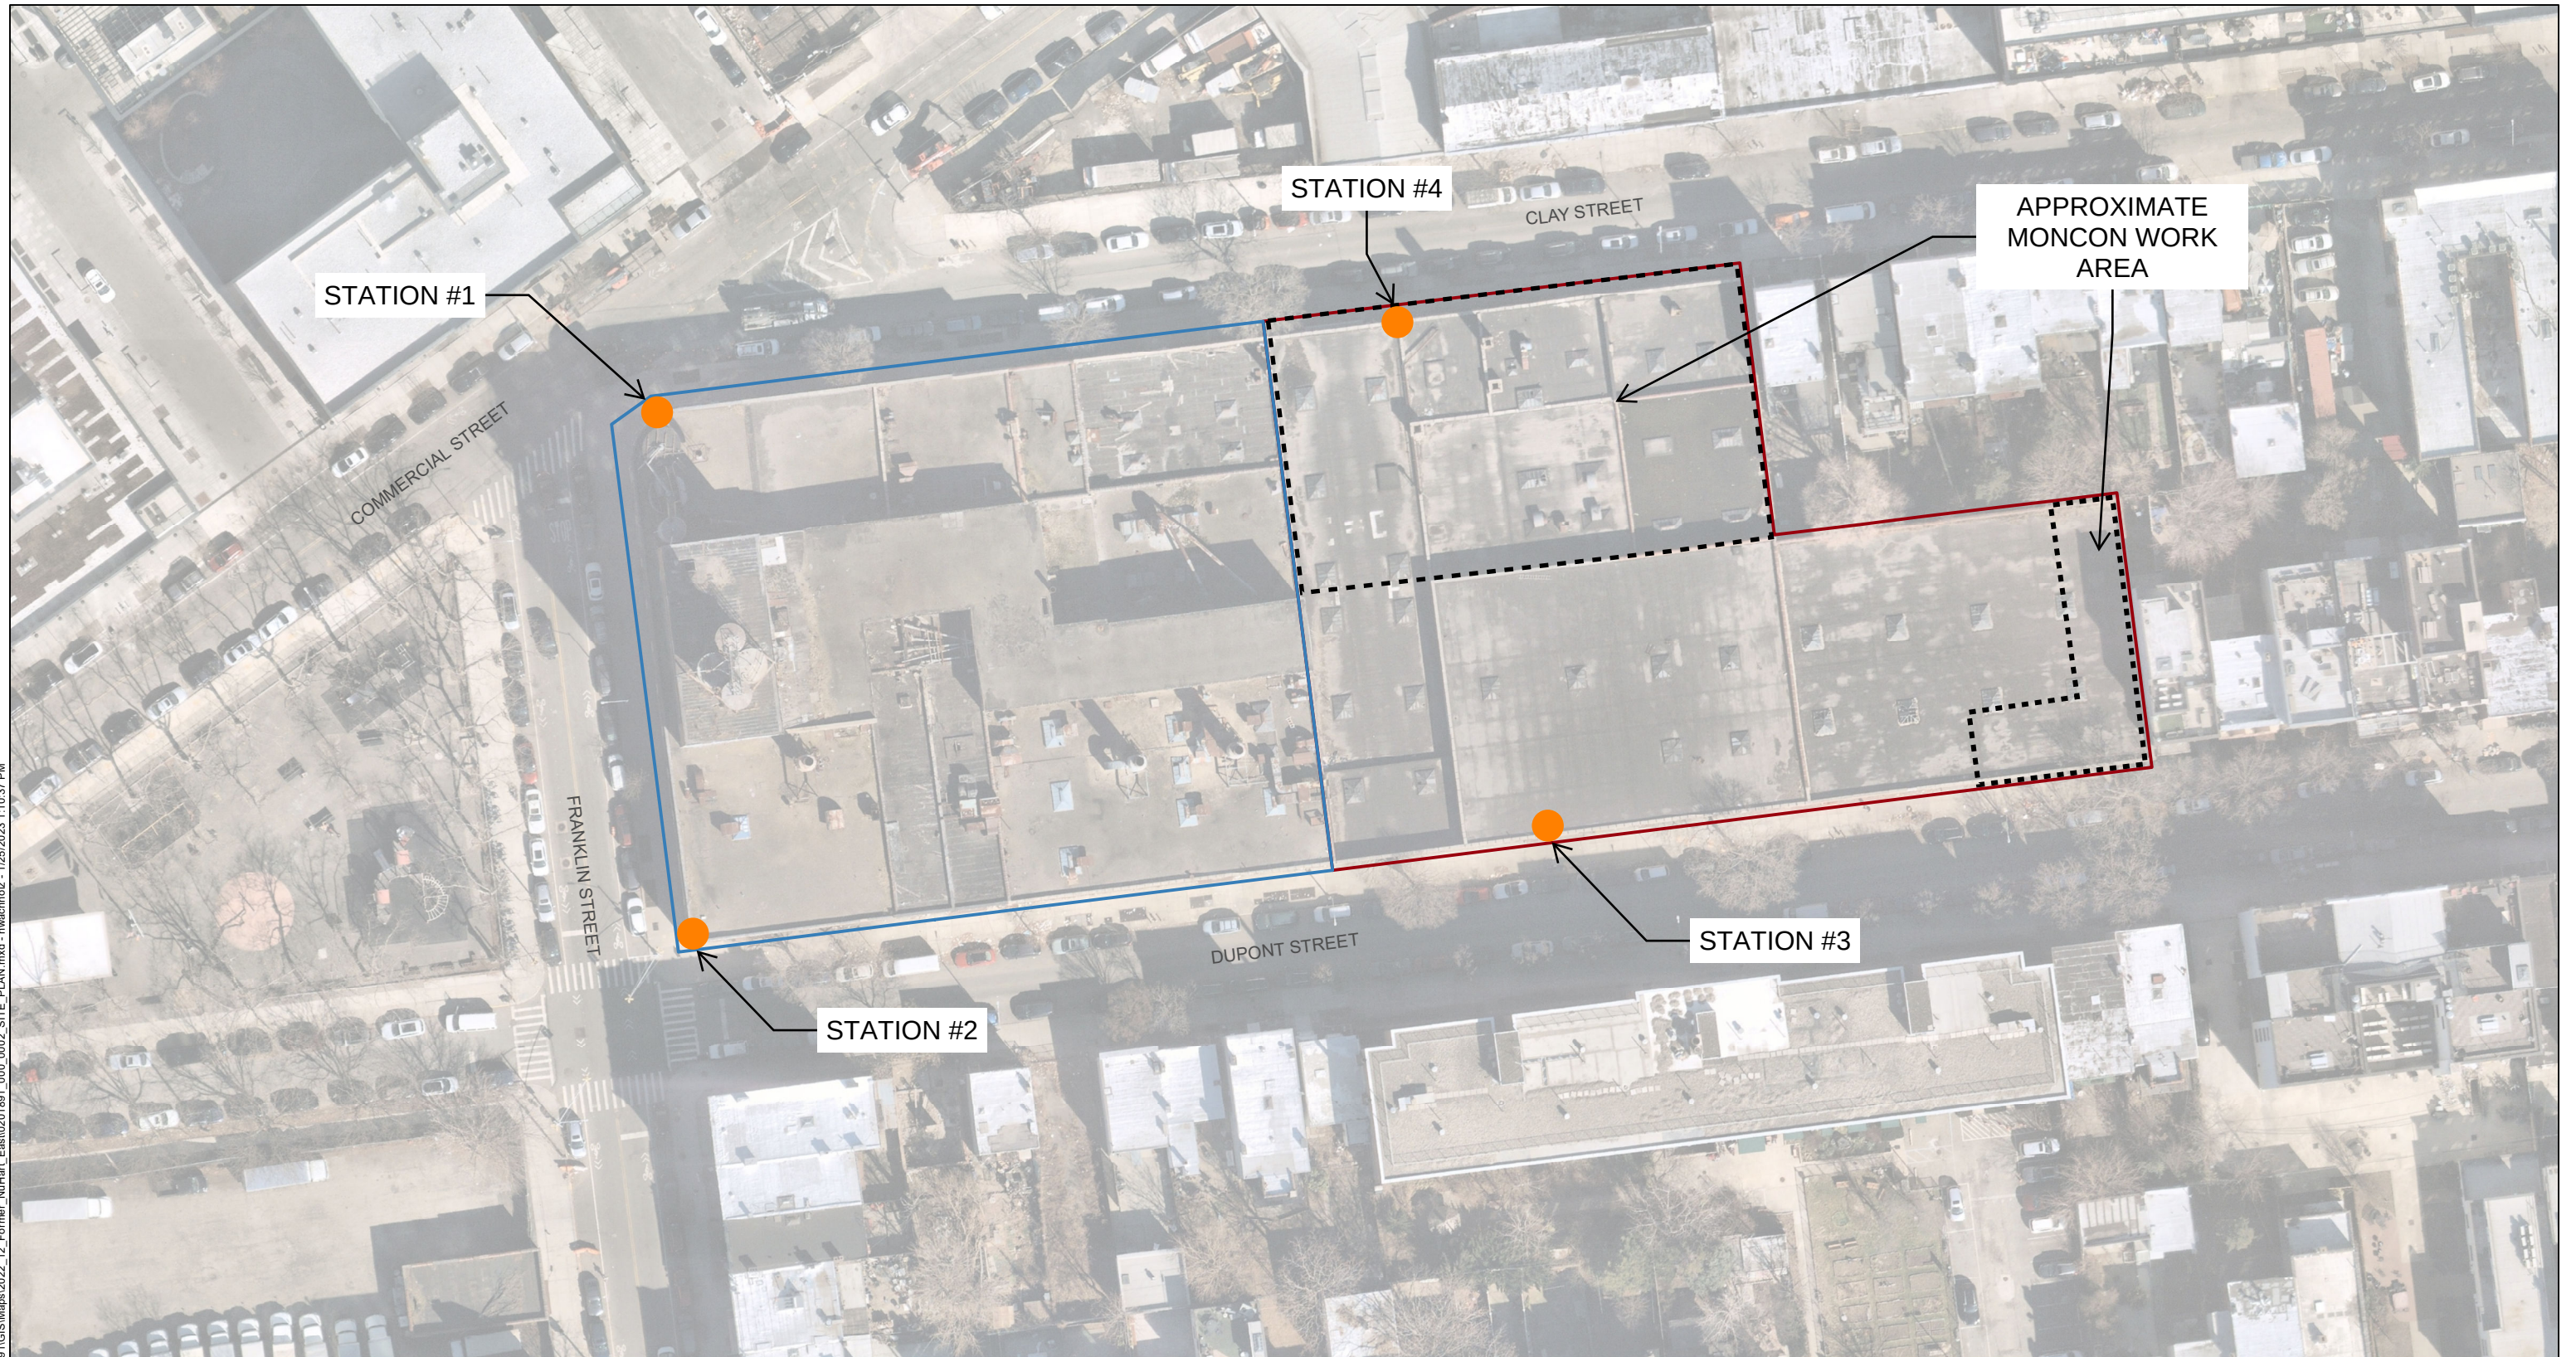

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

APRIL 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-04-06

On-Site (OU-1) Work Activities

Personnel : S. Sotomayor
 Weather : 53 to 69°F, Sunny
 Humidity : 93%
 Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.030PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:30	0.046	0.030	0.047	0.080	0.0	0.0	0.0	0.0		
07:45	0.038	0.028	0.036	0.060	0.0	0.0	0.0	0.0		
08:00	0.034	0.025	0.032	0.052	0.0	0.0	0.0	0.0		
08:15	0.034	0.024	0.031	0.051	0.0	0.0	0.0	0.0		
08:30	0.031	0.022	0.029	0.048	0.0	0.0	0.0	0.0		
08:45	0.030	0.021	0.027	0.047	0.0	0.0	0.0	0.0		
09:00	0.031	0.022	0.029	0.048	0.0	0.0	0.0	0.0		
09:15	0.032	0.023	0.032	0.049	0.0	0.0	0.0	0.0		
09:30	0.032	0.023	0.033	0.049	0.0	0.0	0.0	0.0		
09:45	0.033	0.023	0.033	0.050	0.0	0.0	0.0	0.0		
10:00	0.034	0.024	0.040	0.052	0.0	0.0	0.0	0.0		
10:15	0.036	0.026	0.042	0.052	0.0	0.0	0.0	0.0		
10:30	0.037	0.026	0.039	0.053	0.0	0.0	0.0	0.0		
10:45	0.039	0.031	0.041	0.056	0.0	0.0	0.0	0.0		
11:00	0.042	0.031	0.046	0.058	0.0	0.0	0.0	0.0		
11:15	0.047	0.033	0.049	0.061	0.0	0.0	0.0	0.0		
11:30	0.047	0.031	0.048	0.063	0.0	0.0	0.0	0.0		
11:45	0.047	0.031	0.047	0.066	0.0	0.0	0.0	0.0		
12:00	0.048	0.031	0.049	0.067	0.0	0.0	0.0	0.1		
12:15	0.048	0.031	0.050	0.064	0.0	0.0	0.0	0.0		
12:30	0.048	0.031	0.050	0.064	0.0	0.0	0.0	0.0		
12:45	0.045	0.030	0.046	0.060	0.0	0.0	0.0	0.0		
13:00	0.044	0.029	0.044	0.059	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.041	0.027	0.045	0.058	0.0	0.0	0.0	0.0		
13:30	0.036	0.025	0.036	0.051	0.0	0.0	0.0	0.0		
13:45	0.032	0.022	0.033	0.047	0.0	0.0	0.0	0.0		
14:00	0.027	0.020	0.029	0.044	0.0	0.0	0.0	0.0		
14:15	0.019	0.015	0.021	0.038	0.0	0.0	0.0	0.0		
14:30	0.017	0.014	0.017	0.034	0.0	0.0	0.0	0.0		
14:45	0.013	0.012	0.016	0.031	0.0	0.0	0.0	0.0		
15:00	0.012	0.012	0.012	0.029	0.0	0.0	0.0	0.0		
15:15	0.011	0.010	0.014	0.029	0.0	0.0	0.0	0.0		
15:30	0.009	0.010	0.010	0.026	0.0	0.0	0.0	0.0		
15:45	0.010	0.010	0.009	0.026	0.0	0.0	0.0	0.0		
16:00	0.010	0.010	0.008	0.026	0.0	0.0	0.0	0.0		
16:15	0.010	0.010	0.009	0.026	0.0	0.0	0.0	0.0		
16:30	0.015	0.012	0.014	0.028	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

- Soil/Fill disposal is summarized below:

Notes:
Soil from OU-2 only.
Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:00 am to 4:30 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.


- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:



Photo 1: View of site conditions, facing southwest.

GIS: \\haleyaldrich.com\share\CP\Projects\201891\GIS\Maps\2022_12_Former_Nuhart_East\020189_000_0002_SITE_PLAN.mxd - hwalcholz - 1/25/2023 1:10:37 PM

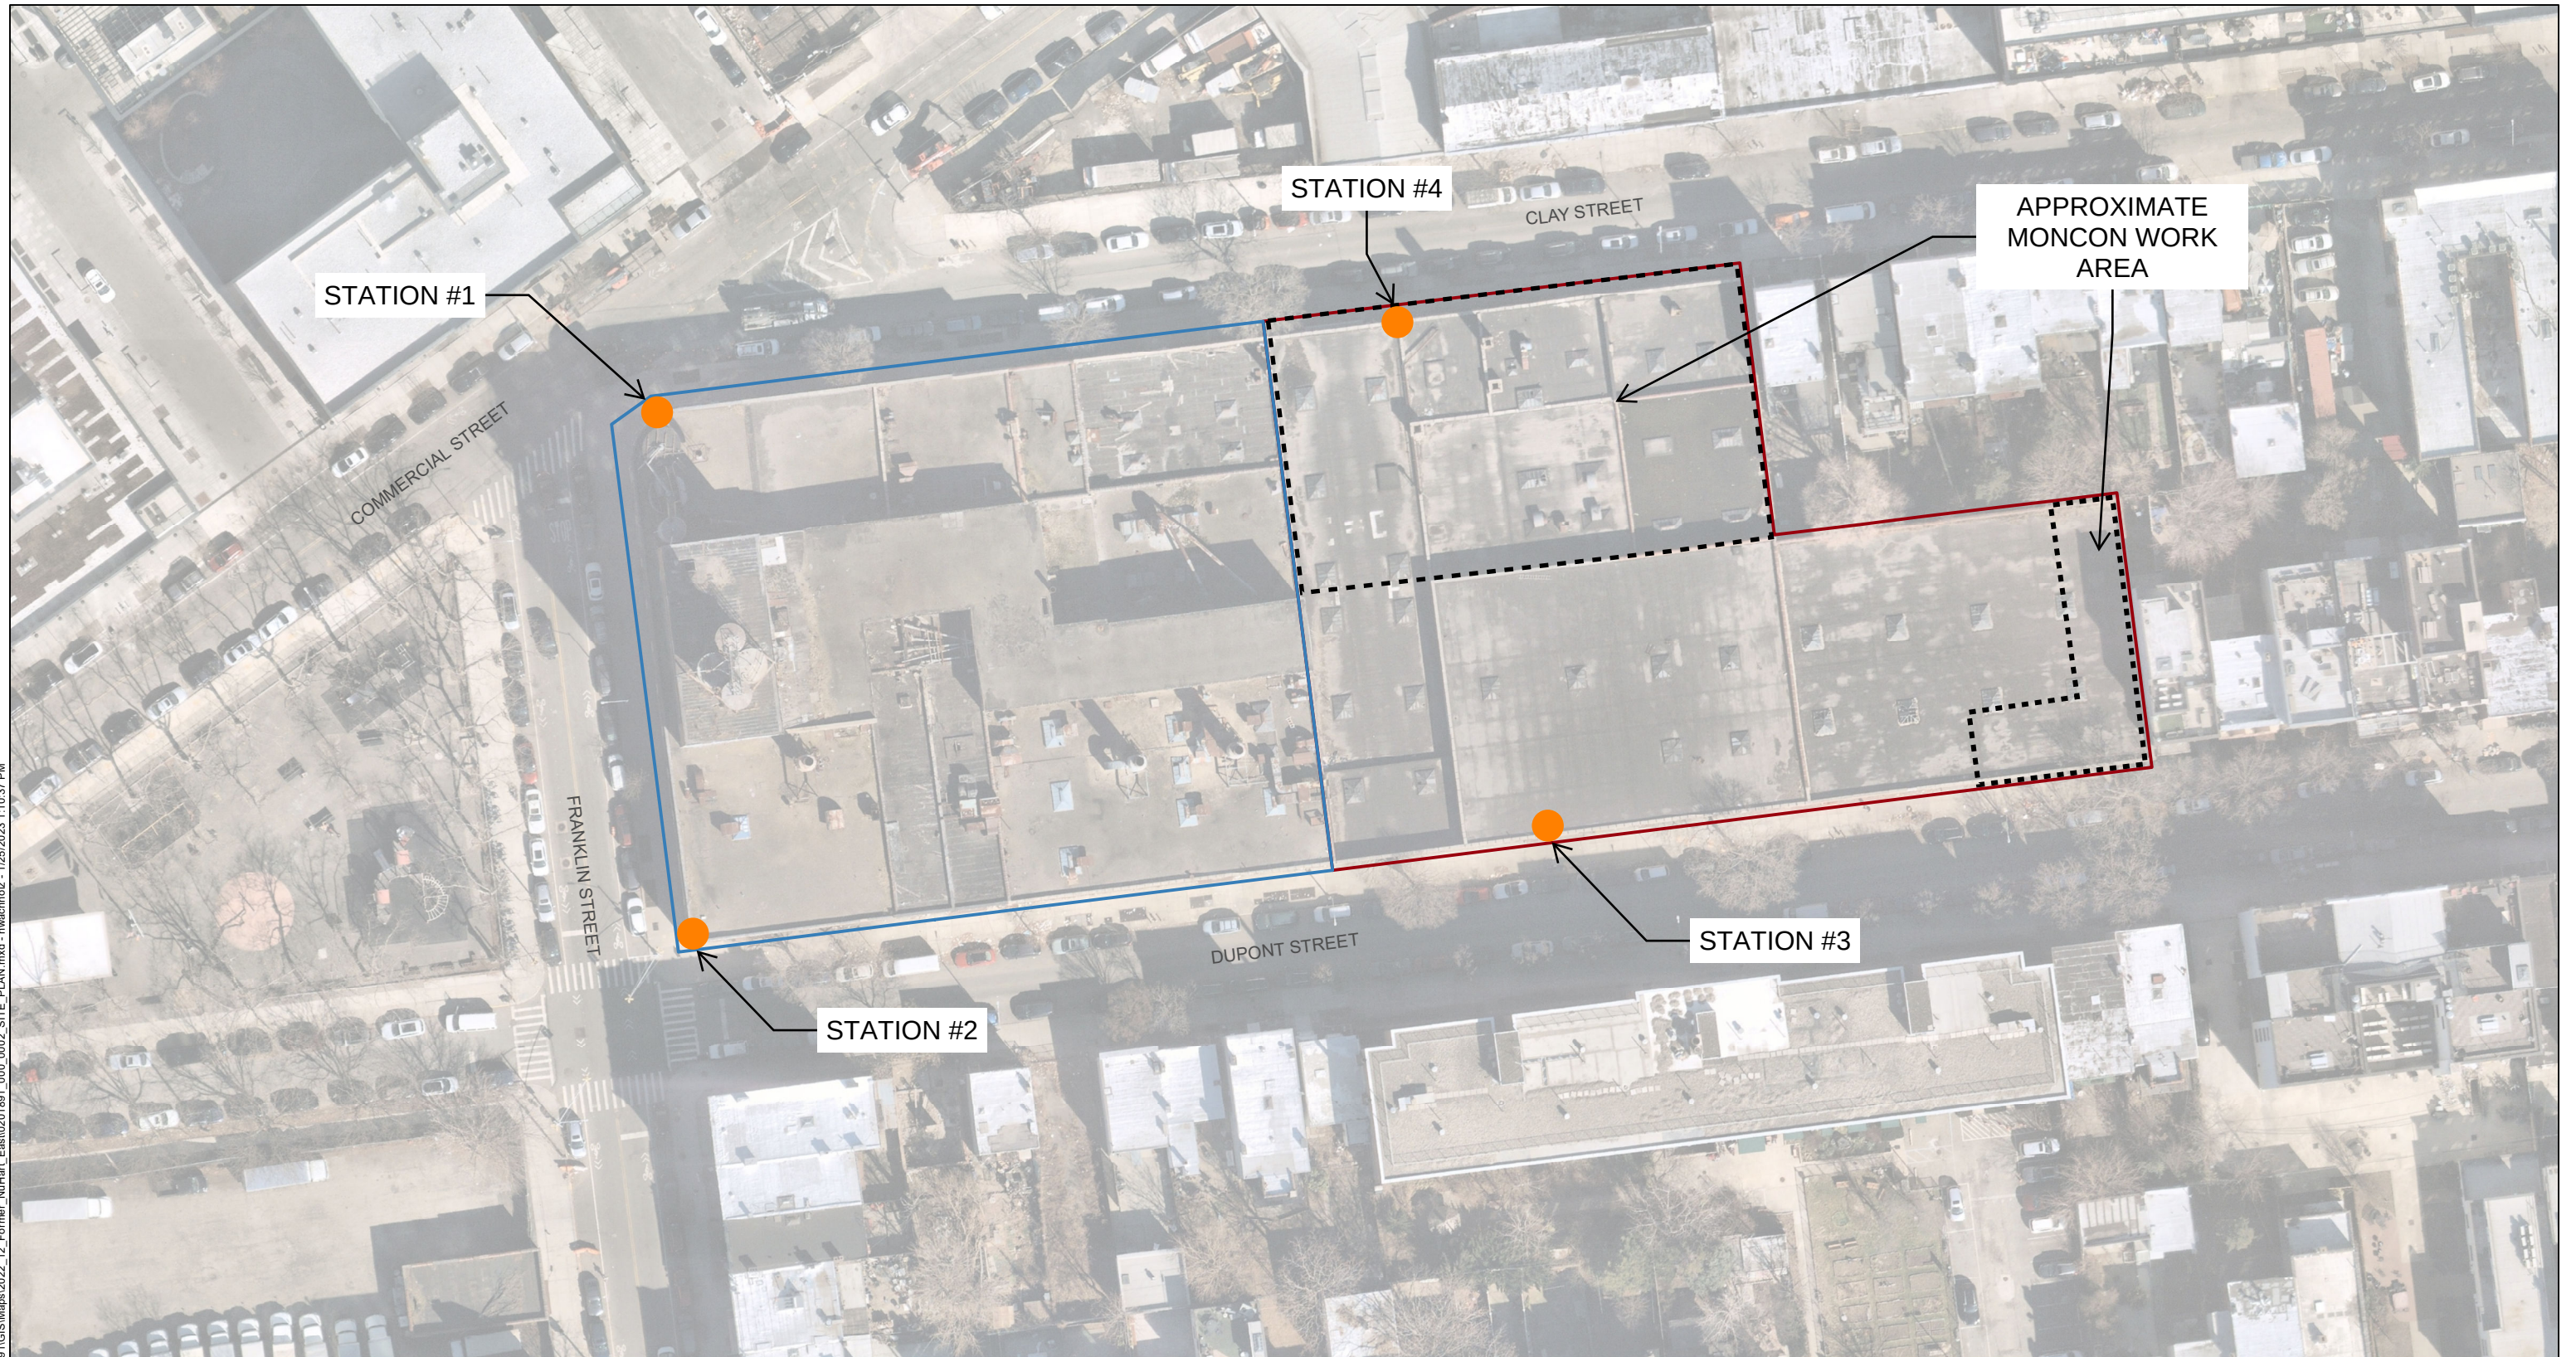

LEGEND

- NUHART EAST
- NUHART WEST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 60 120
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
49 DUPONT STREET
BROOKLYN, NY

SITE PLAN

APRIL 2023

FIGURE 1

Former NuHart West Site

0203497

Air Monitoring Log

Date : 2023-04-07

On-Site (OU-1) Work Activities

Personnel : S. SotomayorWeather : 53 to 69°F, SunnyHumidity : 33%Wind Direction : NW to SEParticulate Background (mg/m³) : 0.008PID Background (ppm) : 0.0Action Levels : Downwind perimeter of work area above background levelsPID (ppm) : > 5 ppm for the 15-min averageDust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.041	0.008	0.013	0.045	0.0	0.0	0.0	0.0		
07:15	0.020	0.009	0.008	0.029	0.0	0.0	0.0	0.0		
07:30	0.010	0.008	0.006	0.026	0.0	0.0	0.0	0.0		
07:45	0.009	0.008	0.008	0.026	0.0	0.0	0.0	0.0		
08:00	0.008	0.008	0.007	0.026	0.0	0.0	0.0	0.0		
08:15	0.008	0.009	0.007	0.026	0.0	0.0	0.0	0.0		
08:30	0.007	0.009	0.007	0.026	0.0	0.0	0.0	0.0		
08:45	0.007	0.009	0.008	0.026	0.0	0.0	0.0	0.0		
09:00	0.008	0.009	0.010	0.026	0.0	0.0	0.0	0.0		
09:15	0.008	0.009	0.008	0.026	0.0	0.0	0.0	0.0		
09:30	0.007	0.008	0.008	0.026	0.0	0.0	0.0	0.0		
09:45	0.007	0.009	0.008	0.026	0.0	0.0	0.0	0.0		
10:00	0.007	0.008	0.009	0.026	0.0	0.0	0.0	0.0		
10:15	0.007	0.008	0.006	0.025	0.0	0.0	0.0	0.0		
10:30	0.007	0.009	0.009	0.026	0.0	0.0	0.0	0.0		
10:45	0.007	0.008	0.007	0.026	0.0	0.0	0.0	0.0		
11:00	0.007	0.008	0.012	0.027	0.0	0.0	0.0	0.0		
11:15	0.007	0.008	0.007	0.026	0.0	0.0	0.0	0.0		
11:30	0.007	0.008	0.007	0.027	0.0	0.0	0.0	0.0		
11:45	0.008	0.010	0.008	0.026	0.0	0.0	0.0	0.0		
12:00	0.007	0.009	0.008	0.025	0.0	0.0	0.0	0.0		
12:15	0.008	0.009	0.010	0.027	0.0	0.0	0.0	0.0		
12:30	0.007	0.008	0.010	0.025	0.0	0.0	0.0	0.0		
12:45	0.006	0.008	0.006	0.026	0.0	0.0	0.0	0.0		
13:00	0.007	0.008	0.006	0.025	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.007	0.008	0.007	0.028	0.0	0.0	0.0	0.0		
13:30	0.007	0.010	0.010	0.027	0.0	0.0	0.0	0.0		
13:45	0.011	0.010	0.008	0.027	0.0	0.0	0.0	0.0		
14:00	0.014	0.011	0.011	0.027	0.0	0.0	0.0	0.0		
14:15	0.013	0.009	0.012	0.031	0.0	0.0	0.0	0.0		
14:30	0.009	0.009	0.027	0.031	0.0	0.0	0.0	0.0		
14:45	0.009	0.009	0.013	0.029	0.0	0.0	0.0	0.0		
15:00	0.009	0.011	0.011	0.029	0.0	0.0	0.0	0.0		
15:15	0.008	0.013	0.015	0.028	0.0	0.0	0.0	0.0		
15:30	0.008	0.009	0.009	0.035	0.0	0.0	0.0	0.0		
15:45	0.008	0.011	0.010	0.029	0.0	0.0	0.0	0.0		
16:00	0.007	0.009	0.010	0.030	0.0	0.0	0.0	0.0		
16:15	0.007	0.008	0.009	0.028	0.0	0.0	0.0	0.0		
16:30	0.006	0.008	0.008		0.0	0.0	0.0			



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

- Soil/Fill disposal is summarized below:

Notes:

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

- None

Community air monitoring was performed at two upwind and two downwind locations during site activities on-Site from 7:15 am to 5:00 pm. No intrusive work on-site. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:



Photo 1: View of site conditions, facing north.

GIS: \\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Fomer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM



LEGEND

PROPOSED ENDPOINT SAMPLE

SITE BOUNDARY

TAX LOT BOUNDARY

NUHART EAST

NUHART WEST

APPROXIMATE WORK AREA

CAMP STATION

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.

2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING

3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

N

0

40

80

SCALE IN FEET

H

A

L

E

Y

A

L

D

R

I

C

H

FORMER NUHART SITE

65, 75 DUPONT STREET

BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-10

Personnel : M. Boland & S. Sotomayor
Weather : 53-63°F, Sunny
Humidity : 42%
Wind Direction : SW to NE

Particulate Background (mg/m³) : 0.011
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:15	0.029	0.011	0.015	0.037	0.0	0.0	0.0	0.0		
07:30	0.024	0.011	0.016	0.038	0.0	0.0	0.0	0.0		
07:45	0.020	0.012	0.015	0.030	0.0	0.0	0.0	0.0		
08:00	0.017	0.010	0.013	0.029	0.0	0.0	0.0	0.0		
08:15	0.012	0.010	0.014	0.029	0.0	0.0	0.0	0.0		
08:30	0.012	0.010	0.009	0.030	0.0	0.0	0.0	0.0		
08:45	0.015	0.011	0.011	0.037	0.0	0.0	0.0	0.0		
09:00	0.013	0.011	0.011	0.034	0.0	0.0	0.0	0.0		
09:15	0.012	0.011	0.014	0.033	0.0	0.0	0.0	0.0		
09:30	0.011	0.011	0.013	0.041	0.0	0.0	0.0	0.0		
09:45	0.010	0.010	0.011	0.030	0.0	0.0	0.0	0.0		
10:00	0.010	0.010	0.011	0.034	0.0	0.0	0.0	0.0		
10:15	0.011	0.010	0.017	0.031	0.0	0.0	0.0	0.0		
10:30	0.010	0.010	0.011	0.029	0.0	0.0	0.0	0.0		
10:45	0.010	0.010	0.011	0.029	0.0	0.0	0.0	0.0		
11:00	0.010	0.010	0.014	0.035	0.0	0.0	0.0	0.0		
11:15	0.011	0.011	0.018	0.033	0.0	0.0	0.0	0.0		
11:30	0.013	0.010	0.013	0.042	0.0	0.0	0.0	0.0		
11:45	0.011	0.010	0.013	0.030	0.0	0.0	0.0	0.0		
12:00	0.011	0.010	0.011	0.029	0.0	0.0	0.0	0.0		
12:15	0.011	0.010	0.011	0.029	0.0	0.0	0.0	0.0		
12:30	0.010	0.010	0.011	0.027	0.0	0.0	0.0	0.0		
12:45	0.010	0.010	0.010	0.027	0.0	0.0	0.0	0.0		
13:00	0.010	0.010	0.011	0.027	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.009	0.009	0.011	0.030	0.0	0.0	0.0	0.0		
13:30	0.009	0.009	0.009	0.030	0.0	0.0	0.0	0.0		
13:45	0.009	0.009	0.012	0.028	0.0	0.0	0.0	0.0		
14:00	0.009	0.009	0.011	0.029	0.0	0.0	0.0	0.0		
14:15	0.009	0.009	0.015	0.031	0.0	0.0	0.0	0.0		
14:30	0.012	0.009	0.012	0.031	0.0	0.0	0.0	0.0		
14:45	0.010	0.009	0.009	0.033	0.0	0.0	0.0	0.0		
15:00	0.010	0.010	0.010	0.029	0.0	0.0	0.0	0.0		
15:15	0.009	0.010	0.011	0.027	0.0	0.0	0.0	0.0		
15:30	0.008	0.009	0.010	0.026	0.0	0.0	0.0	0.0		
15:45	0.009	0.009	0.010	0.026	0.0	0.0	0.0	0.0		
16:00	0.011	0.010	0.011	0.027	0.0	0.0	0.0	0.0		
16:15	0.011	0.011	0.017	0.028	0.0	0.0	0.0	0.0		
16:30	0.013	0.012	0.015	0.028	0.0	0.0	0.0	0.0		
16:45	0.012	0.010	0.017	0.029	0.0	0.0	0.0	0.0		
17:00	0.010	0.010	0.010	0.028	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

- Soil/Fill disposal is summarized below:

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

Community air monitoring was performed at two upwind and two downwind locations during non-intrusive work activities on-Site from 7:15 am to 5:15 pm. The 15-minute average concentration of particulates exceeded action levels at CAMP Station 4 from 1:45 pm to 2:15 pm due to dry conditions and strong wind gusts. Station 4 was located adjacent to tent installation activities and no intrusive work was completed in the vicinity throughout the day. The contractor sprayed the surface of the site with water to suppress dust and particulate readings returned within the action threshold by 2:30 pm.

Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of site conditions, facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\2021\891\GIS\Maps\2023_04_Fomer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM



LEGEND

- PROPOSED ENDPOINT SAMPLE
- SITE BOUNDARY
- TAX LOT BOUNDARY
- NUHART WEST
- APPROXIMATE WORK AREA
- CAMP STATION
- NUHART EAST

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING
3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 40 80
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-11

Personnel : M. Boland & S. Sotomayor
Weather : 57-69°F, Sunny
Humidity : 48%
Wind Direction : SW to NE

Particulate Background (mg/m³) : 0.013
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:15	0.021	0.013	0.025	0.048	0.0	0.0	0.0	0.0		
07:30	0.015	0.012	0.014	0.035	0.0	0.0	0.0	0.0		
07:45	0.013	0.012	0.015	0.036	0.0	0.0	0.0	0.0		
08:00	0.012	0.011	0.012	0.056	0.0	0.0	0.0	0.0		
08:15	0.012	0.012	0.016	0.036	0.0	0.0	0.0	0.0		
08:30	0.012	0.012	0.013	0.035	0.0	0.0	0.0	0.0		
08:45	0.013	0.012	0.013	0.036	0.0	0.0	0.0	0.0		
09:00	0.013	0.015	0.017	0.047	0.0	0.0	0.0	0.0		
09:15	0.013	0.012	0.014	0.040	0.0	0.0	0.0	0.0		
09:30	0.013	0.012	0.015	0.036	0.0	0.0	0.0	0.0		
09:45	0.013	0.012	0.017	0.033	0.0	0.0	0.0	0.0		
10:00	0.013	0.013	0.016	0.040	0.0	0.0	0.0	0.0		
10:15	0.011	0.011	0.018	0.033	0.0	0.0	0.0	0.0		
10:30	0.011	0.011	0.016	0.031	0.0	0.0	0.0	0.0		
10:45	0.011	0.012	0.016	0.031	0.0	0.0	0.0	0.0		
11:00	0.011	0.011	0.013	0.032	0.0	0.0	0.0	0.0		
11:15	0.014	0.011	0.013	0.039	0.0	0.0	0.0	0.0		
11:30	0.011	0.011	0.012	0.046	0.0	0.0	0.0	0.0		
11:45	0.013	0.010	0.013	0.033	0.0	0.0	0.0	0.0		
12:00	0.011	0.011	0.011	0.031	0.0	0.0	0.0	0.0		
12:15	0.011	0.010	0.015	0.035	0.0	0.0	0.0	0.0		
12:30	0.010	0.011	0.010	0.030	0.0	0.0	0.0	0.0		
12:45	0.011	0.011	0.009	0.033	0.0	0.0	0.0	0.0		
13:00	0.011	0.010	0.009	0.029	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.011	0.016	0.018	0.061	0.0	0.0	0.0	0.0		
13:30	0.012	0.011	0.041	0.103	0.0	0.0	0.0	0.0		
13:45	0.012	0.013	0.025	0.250	0.0	0.0	0.0	0.0		Particulate exceedance at CAMP Station 4 from 13:45 pm to 14:15 due to dry conditions and strong wind gusts. Station 4 was located adjacent to tent installation activities and no intrusive work was completed in the vicinity throughout the day. Contractor sprayed the surface of the site with water to suppress dust and particulate readings returned within threshold by 14:30.
14:00	0.035	0.015	0.025	0.476	0.0	0.0	0.0	0.0		
14:15	0.023	0.015	0.023	0.374	0.0	0.0	0.0	0.0		
14:30	0.017	0.009	0.017	0.133	0.0	0.0	0.0	0.0		
14:45	0.018	0.010	0.018	0.106	0.0	0.0	0.0	0.0		
15:00	0.017	0.011	0.049	0.113	0.0	0.0	0.0	0.0		
15:15	0.013	0.012	0.030	0.053	0.0	0.0	0.0	0.0		
15:30	0.012	0.011	0.015	0.046	0.0	0.0	0.0	0.0		
15:45	0.014	0.011	0.020	0.046	0.0	0.0	0.0	0.0		
16:00	0.016	0.012	0.017	0.046	0.0	0.0	0.0	0.0		
16:15	0.018	0.014	0.017	0.045	0.0	0.0	0.0	0.0		
16:30	0.013	0.011	0.017	0.048	0.0	0.0	0.0	0.0		
16:45	0.012	0.011	0.015	0.043	0.0	0.0	0.0	0.0		
17:00	0.013	0.013	0.022	0.042	0.0	0.0	0.0	0.0		
17:15	0.013	0.012	0.012		0.0	0.0	0.0			



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

- Soil/Fill disposal is summarized below:

Notes:
Soil from OU-2 only.
Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

- None

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:00 am to 6:00 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:



Photo 1: View of site conditions, facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM



LEGEND

PROPOSED ENDPOINT SAMPLE

NUHART WEST

SITE BOUNDARY

APPROXIMATE WORK AREA

TAX LOT BOUNDARY


CAMP STATION

NUHART EAST

- NOTES**
1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.

2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING

3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

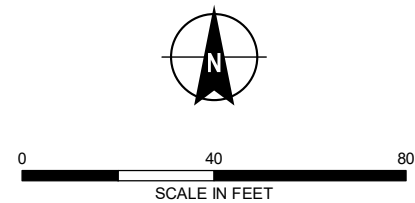

**HALEY
ALDRICH** FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-12

Personnel : S. Sotomayor
Weather : 62-75°F, Sunny
Humidity : 52%
Wind Direction : SW to NE

Particulate Background (mg/m³) : 0.011
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.038	0.011	0.024	0.060	0.0	0.0	0.0	0.0		
07:15	0.023	0.010	0.015	0.043	0.0	0.0	0.0	0.0		
07:30	0.017	0.010	0.018	0.038	0.0	0.0	0.0	0.0		
07:45	0.015	0.010	0.020	0.037	0.0	0.0	0.0	0.0		
08:00	0.014	0.010	0.012	0.036	0.0	0.0	0.0	0.0		
08:15	0.014	0.010	0.015	0.040	0.0	0.0	0.0	0.0		
08:30	0.012	0.010	0.018	0.039	0.0	0.0	0.0	0.0		
08:45	0.011	0.010	0.013	0.035	0.0	0.0	0.0	0.0		
09:00	0.011	0.009	0.010	0.034	0.0	0.0	0.0	0.0		
09:15	0.012	0.009	0.020	0.039	0.0	0.0	0.0	0.0		
09:30	0.011	0.010	0.010	0.034	0.0	0.0	0.0	0.0		
09:45	0.010	0.009	0.008	0.032	0.0	0.0	0.0	0.0		
10:00	0.010	0.011	0.011	0.033	0.0	0.0	0.0	0.0		
10:15	0.010	0.010	0.020	0.033	0.0	0.0	0.0	0.0		
10:30	0.009	0.010	0.011	0.033	0.0	0.0	0.0	0.0		
10:45	0.009	0.018	0.011	0.033	0.0	0.0	0.0	0.0		
11:00	0.010	0.013	0.014	0.034	0.0	0.0	0.0	0.0		
11:15	0.010	0.012	0.015	0.032	0.0	0.0	0.0	0.0		
11:30	0.009	0.011	0.011	0.040	0.0	0.0	0.0	0.0		
11:45	0.011	0.011	0.015	0.041	0.0	0.0	0.0	0.0		
12:00	0.010	0.011	0.020	0.036	0.0	0.0	0.0	0.0		
12:15	0.011	0.014	0.009	0.034	0.0	0.0	0.0	0.0		
12:30	0.010	0.012	0.011	0.034	0.0	0.0	0.0	0.0		
12:45	0.009	0.010	0.010	0.034	0.0	0.0	0.0	0.0		
13:00	0.011	0.010	0.008	0.034	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.012	0.012	0.011	0.033	0.0	0.0	0.0	0.0		
13:30	0.011	0.019	0.018	0.036	0.0	0.0	0.0	0.0		
13:45	0.014	0.011	0.011	0.039	0.0	0.0	0.0	0.0		
14:00	0.011	0.010	0.012	0.037	0.0	0.0	0.0	0.0		
14:15	0.010	0.012	0.025	0.035	0.0	0.0	0.0	0.0		
14:30	0.010	0.013	0.010	0.033	0.0	0.0	0.0	0.0		
14:45	0.010	0.010	0.018	0.038	0.0	0.0	0.0	0.0		
15:00	0.010	0.011	0.009	0.039	0.0	0.0	0.0	0.0		
15:15	0.010	0.012	0.010	0.034	0.0	0.0	0.0	0.0		
15:30	0.010	0.010	0.012	0.035	0.0	0.0	0.0	0.0		
15:45	0.010	0.010	0.009	0.034	0.0	0.0	0.0	0.0		
16:00	0.011	0.011	0.010	0.037	0.0	0.0	0.0	0.0		
16:15	0.010	0.010	0.009	0.034	0.0	0.0	0.0	0.0		
16:30	0.010	0.010	0.008	0.034	0.0	0.0	0.0	0.0		
16:45	0.010	0.010	0.008	0.033	0.0	0.0	0.0	0.0		
17:00	0.010	0.010	0.008	0.033	0.0	0.0	0.0	0.0		
17:15	0.010	0.010	0.010	0.034	0.0	0.0	0.0	0.0		
17:30	0.010	0.010	0.009	0.032	0.0	0.0	0.0	0.0		
17:45	0.011	0.010	0.008	0.032	0.0	0.0	0.0	0.0		
18:00	0.010	0.010	0.008	0.032	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Material Export:

- [illegible]

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

- None

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:00 am to 5:30 pm. An equipment malfunction occurred at Station #2 from 7:00 am to 8:00 am. The issue was troubleshooted with a technician and the station was running by 8:00 am. Visual and olfactory monitoring was conducted in this location during this time. No visual dust was observed, and no intrusive work was conducted in the vicinity of the station. No 15-minute average concentrations exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of site conditions, facing southwest.

GIS: \\haleyaldrich.com\share\CP\Projects\2021\891\GIS\Map\2023_04_Fomer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM




LEGEND

- | | | | |
|--|--------------------------|--|-----------------------|
| | PROPOSED ENDPOINT SAMPLE | | NUHART WEST |
| | SITE BOUNDARY | | APPROXIMATE WORK AREA |
| | TAX LOT BOUNDARY | | CAMP STATION |
| | NUHART EAST | | |

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING
3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



**HALEY
ALDRICH**

FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-13

Personnel : S. Sotomayor
Weather : 70-80°F, Sunny
Humidity : 45%
Wind Direction : SW to NE

Particulate Background (mg/m³) : 0.011
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.030		0.011	0.046	0.0		0.0	0.0		Equipment malfunction at Station #2 from 7:00 to 8:00. Troubleshoot issue with technician and Station running by 8:00. Visual and olfactory monitoring was conducted in this location during this time. No visual dust observed and no intrusive work in the vicinity.
07:15	0.020		0.012	0.041	0.0		0.0	0.0		
07:30	0.017		0.013	0.038	0.0		0.0	0.0		
07:45	0.016		0.014	0.037	0.0		0.0	0.0		
08:00	0.013		0.017	0.041	0.0		0.0	0.0		
08:15	0.013	0.012	0.013	0.036	0.0	0.0	0.0	0.0		
08:30	0.012	0.012	0.014	0.036	0.0	0.0	0.0	0.0		
08:45	0.015	0.021	0.018	0.040	0.0	0.0	0.0	0.0		
09:00	0.013	0.013	0.015	0.036	0.0	0.0	0.0	0.0		
09:15	0.012	0.011	0.016	0.036	0.0	0.0	0.0	0.0		
09:30	0.012	0.011	0.011	0.041	0.0	0.0	0.0	0.0		
09:45	0.012	0.011	0.012	0.036	0.0	0.0	0.0	0.0		
10:00	0.013	0.013	0.013	0.050	0.0	0.0	0.0	0.0		
10:15	0.011	0.010	0.011	0.042	0.0	0.0	0.0	0.0		
10:30	0.011	0.011	0.011	0.036	0.0	0.0	0.0	0.0		
10:45	0.010	0.011	0.012	0.038	0.0	0.0	0.0	0.0		
11:00	0.010	0.011	0.011	0.035	0.0	0.0	0.0	0.0		
11:15	0.010	0.011	0.011	0.035	0.0	0.0	0.0	0.0		
11:30	0.010	0.010	0.009	0.034	0.0	0.0	0.0	0.0		
11:45	0.012	0.011	0.010	0.037	0.0	0.0	0.0	0.0		
12:00	0.010	0.010	0.013	0.039	0.0	0.0	0.0	0.0		
12:15	0.010	0.010	0.010	0.035	0.0	0.0	0.0	0.0		
12:30	0.010	0.011	0.009	0.045	0.0	0.0	0.0	0.0		
12:45	0.010	0.010	0.010	0.037	0.0	0.0	0.0	0.0		
13:00	0.011	0.010	0.009	0.039	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.010	0.011	0.012	0.043	0.0	0.0	0.0	0.0		
13:30	0.010	0.011	0.012	0.039	0.0	0.0	0.0	0.0		
13:45	0.012	0.011	0.015	0.045	0.0	0.0	0.0	0.0		
14:00	0.011	0.010	0.025	0.038	0.0	0.0	0.0	0.0		
14:15	0.011	0.011	0.013	0.047	0.0	0.0	0.0	0.0		
14:30	0.014	0.011	0.014	0.040	0.0	0.0	0.0	0.0		
14:45	0.014	0.011	0.031	0.040	0.0	0.0	0.0	0.0		
15:00	0.013	0.011	0.016	0.037	0.0	0.0	0.0	0.0		
15:15	0.012	0.010	0.012	0.036	0.0	0.0	0.0	0.0		
15:30	0.012	0.010	0.012	0.035	0.0	0.0	0.0	0.0		
15:45	0.012	0.011	0.015	0.035	0.0	0.0	0.0	0.0		
16:00	0.011	0.010	0.011	0.033	0.0	0.0	0.0	0.0		
16:15	0.011	0.010	0.015	0.034	0.0	0.0	0.0	0.0		
16:30	0.011	0.011	0.020	0.033	0.0	0.0	0.0	0.0		
16:45	0.012	0.011	0.018	0.035	0.0	0.0	0.0	0.0		
17:00	0.014	0.013	0.018	0.042	0.0	0.0	0.0	0.0		
17:15	0.013	0.011	0.045	0.061	0.0	0.0	0.0	0.0		
17:30	0.013	0.012	0.015	0.038	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Material Export:

- [illegible]

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

- None

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:00 am to 4:15 pm. No 15-minute average concentrations exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of site conditions, facing southwest.

GIS: \\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM




LEGEND

- | | | | |
|--|--------------------------|--|-----------------------|
| | PROPOSED ENDPOINT SAMPLE | | NUHART WEST |
| | SITE BOUNDARY | | APPROXIMATE WORK AREA |
| | TAX LOT BOUNDARY | | CAMP STATION |
| | NUHART EAST | | |

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING
3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



**HALEY
ALDRICH**

FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-14

Personnel : S. Sotomayor
Weather : 69-76°F, Sunny
Humidity : 41%
Wind Direction : SW to NE

Particulate Background (mg/m³) : 0.015
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.072	0.015	0.031	0.060	0.0	0.0	0.0	0.0		
07:15	0.036	0.012	0.019	0.045	0.1	0.0	0.0	0.0		
07:30	0.025	0.012	0.016	0.045	0.0	0.0	0.0	0.0		
07:45	0.021	0.013	0.017	0.050	0.1	0.0	0.0	0.0		
08:00	0.020	0.012	0.015	0.047	0.1	0.1	0.0	0.1		
08:15	0.019	0.013	0.015	0.041	0.1	0.1	0.0	0.1		
08:30	0.019	0.012	0.015	0.040	0.0	0.0	0.0	0.0		
08:45	0.019	0.015	0.016	0.043	0.0	0.0	0.0	0.0		
09:00	0.019	0.014	0.016	0.040	0.0	0.0	0.0	0.0		
09:15	0.018	0.013	0.018	0.039	0.0	0.0	0.0	0.0		
09:30	0.018	0.014	0.016	0.038	0.0	0.0	0.0	0.0		
09:45	0.018	0.014	0.019	0.041	0.0	0.0	0.0	0.0		
10:00	0.021	0.014	0.022	0.043	0.0	0.0	0.0	0.0		
10:15	0.018	0.015	0.020	0.049	0.1	0.0	0.0	0.0		
10:30	0.017	0.014	0.018	0.045	0.0	0.0	0.0	0.0		
10:45	0.018	0.015	0.018	0.041	0.0	0.0	0.0	0.0		
11:00	0.017	0.015	0.017	0.040	0.0	0.0	0.0	0.0		
11:15	0.017	0.014	0.017	0.040	0.0	0.0	0.0	0.0		
11:30	0.018	0.014	0.017	0.040	0.0	0.0	0.0	0.0		
11:45	0.017	0.014	0.016	0.039	0.0	0.0	0.0	0.0		
12:00	0.016	0.013	0.016	0.038	0.0	0.0	0.0	0.0		
12:15	0.016	0.013	0.017	0.041	0.0	0.0	0.0	0.0		
12:30	0.015	0.013	0.015	0.038	0.0	0.0	0.0	0.0		
12:45	0.012	0.012	0.013	0.036	0.0	0.0	0.0	0.0		
13:00	0.012	0.011	0.012	0.035	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.012	0.012	0.011	0.035	0.0	0.0	0.0	0.0		
13:30	0.012	0.011	0.012	0.036	0.0	0.0	0.0	0.0		
13:45	0.012	0.011	0.012	0.036	0.0	0.0	0.0	0.0		
14:00	0.011	0.011	0.012	0.039	0.0	0.0	0.0	0.0		
14:15	0.012	0.011	0.011	0.036	0.0	0.0	0.0	0.0		
14:30	0.014	0.011	0.014	0.038	0.0	0.0	0.0	0.0		
14:45	0.014	0.012	0.014	0.038	0.0	0.0	0.0	0.0		
15:00	0.015	0.012	0.014	0.038	0.0	0.0	0.0	0.0		
15:15	0.013	0.012	0.013	0.037	0.0	0.0	0.0	0.0		
15:30	0.012	0.011	0.013	0.035	0.0	0.0	0.0	0.0		
15:45	0.012	0.011	0.012	0.037	0.0	0.0	0.0	0.0		
16:00	0.012	0.012	0.012	0.036	0.0	0.0	0.0	0.0		
16:15	0.012	0.011	0.012	0.035	0.0	0.0	0.0	0.0		
16:30	0.012	0.019	0.012		0.0	0.0	0.0			



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Material Export:

- [illegible]

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

- None

Community air monitoring was performed at two upwind and two downwind locations on-Site from 8:45 am to 4:15 pm. No 15-minute average concentrations exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of site conditions, facing southwest.

GIS: \\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM




LEGEND

- | | | | |
|--|--------------------------|--|-----------------------|
| | PROPOSED ENDPOINT SAMPLE | | NUHART WEST |
| | SITE BOUNDARY | | APPROXIMATE WORK AREA |
| | TAX LOT BOUNDARY | | CAMP STATION |
| | NUHART EAST | | |

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING
3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



**HALEY
ALDRICH**

FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-15

Personnel : S. Sotomayor
Weather : 65-73°F, Sunny
Humidity : 72%
Wind Direction : SE to NW

Particulate Background (mg/m³) : 0.016
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
08:45	0.019	0.011	0.016	0.052	0.0	0.0	0.0	0.0		
09:00	0.017	0.010	0.013	0.041	0.0	0.0	0.0	0.0		
09:15	0.016	0.011	0.014	0.038	0.0	0.0	0.0	0.0		
09:30	0.016	0.010	0.012	0.035	0.0	0.0	0.0	0.0		
09:45	0.016	0.010	0.011	0.034	0.0	0.0	0.0	0.0		
10:00	0.013	0.010	0.011	0.033	0.0	0.0	0.0	0.0		
10:15	0.012	0.009	0.010	0.032	0.0	0.0	0.0	0.0		
10:30	0.010	0.010	0.009	0.032	0.0	0.0	0.0	0.0		
10:45	0.009	0.009	0.008	0.033	0.0	0.0	0.0	0.0		
11:00	0.008	0.008	0.007	0.031	0.0	0.0	0.0	0.0		
11:15	0.009	0.009	0.007	0.030	0.0	0.0	0.0	0.0		
11:30	0.010	0.009	0.008	0.031	0.0	0.0	0.0	0.0		
11:45	0.010	0.010	0.008	0.033	0.0	0.0	0.0	0.0		
12:00	0.008	0.009	0.008	0.031	0.0	0.0	0.0	0.0		
12:15	0.008	0.008	0.007	0.031	0.0	0.0	0.0	0.0		
12:30	0.008	0.008	0.007	0.031	0.0	0.0	0.0	0.0		
12:45	0.007	0.009	0.008	0.030	0.0	0.0	0.0	0.0		
13:00	0.008	0.012	0.007	0.030	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.009	0.009	0.009	0.033	0.0	0.0	0.0	0.0		
13:30	0.010	0.009	0.009	0.032	0.0	0.0	0.0	0.0		
13:45	0.011	0.009	0.010	0.033	0.0	0.0	0.0	0.0		
14:00	0.011	0.009	0.010	0.033	0.0	0.0	0.0	0.0		
14:15	0.011	0.009	0.009	0.032	0.0	0.0	0.0	0.0		
14:30	0.009	0.008	0.009	0.032	0.0	0.0	0.0	0.0		
14:45	0.010	0.009	0.010	0.032	0.0	0.0	0.0	0.0		
15:00	0.011	0.009	0.009	0.033	0.0	0.0	0.0	0.0		
15:15	0.013	0.011	0.013	0.034	0.0	0.0	0.0	0.0		
15:30	0.011	0.011	0.010	0.033	0.0	0.0	0.0	0.0		
15:45	0.011	0.009	0.011	0.033	0.0	0.0	0.0	0.0		
16:00	0.009	0.009	0.012	0.031	0.0	0.0	0.0	0.0		
16:15	0.008	0.008	0.014	0.030	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Material Export:

- [illegible]

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

- None

Community air monitoring was performed at two upwind and two downwind locations during intrusive activities on-Site from 7:00 am to 5:00 pm. No 15-minute average concentrations exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

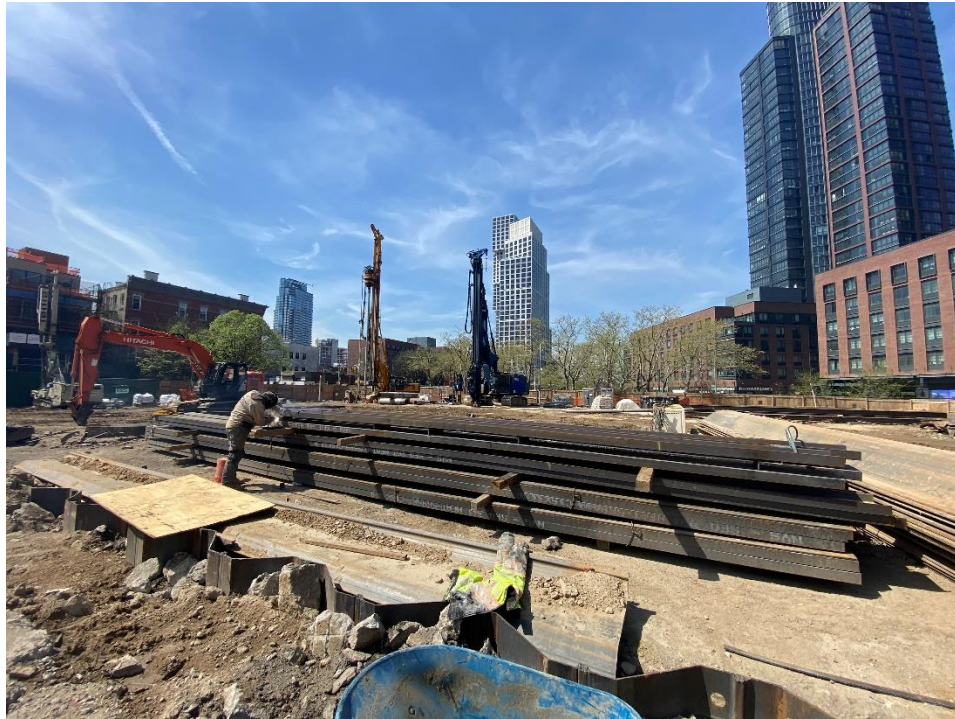


Photo 1: View of site conditions, facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM




LEGEND

- | | | | |
|---|--------------------------|---|-----------------------|
|  | PROPOSED ENDPOINT SAMPLE |  | NUHART WEST |
|  | SITE BOUNDARY |  | APPROXIMATE WORK AREA |
|  | TAX LOT BOUNDARY |  | CAMP STATION |
|  | NUHART EAST | | |

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING
3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



**HALEY
ALDRICH**

FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-17

Personnel : S. Sotomayor
Weather : 60-69°F, Cloudy
Humidity : 91%
Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.021
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.027	0.021	0.027	0.052	0.0	0.0	0.0	0.0		
07:15	0.025	0.021	0.034	0.049	0.0	0.0	0.0	0.0		
07:30	0.026	0.020	0.031	0.051	0.0	0.0	0.0	0.0		
07:45	0.029	0.020	0.030	0.051	0.0	0.0	0.0	0.0		
08:00	0.024	0.017	0.026	0.050	0.0	0.0	0.0	0.0		
08:15	0.023	0.017	0.025	0.048	0.0	0.0	0.0	0.0		
08:30	0.023	0.018	0.027	0.047	0.0	0.0	0.0	0.0		
08:45	0.021	0.017	0.024	0.046	0.0	0.0	0.0	0.0		
09:00	0.017	0.014	0.019	0.043	0.0	0.0	0.0	0.0		
09:15	0.017	0.014	0.020	0.042	0.0	0.0	0.0	0.0		
09:30	0.018	0.014	0.017	0.041	0.0	0.0	0.0	0.0		
09:45	0.019	0.013	0.017	0.043	0.0	0.0	0.0	0.0		
10:00	0.017	0.013	0.017	0.045	0.0	0.0	0.0	0.0		
10:15	0.016	0.013	0.020	0.043	0.0	0.0	0.0	0.0		
10:30	0.018	0.014	0.017	0.043	0.0	0.0	0.0	0.0		
10:45	0.017	0.014	0.022	0.041	0.0	0.0	0.0	0.0		
11:00	0.020	0.014	0.022	0.042	0.0	0.0	0.0	0.0		
11:15	0.020	0.014	0.021	0.042	0.0	0.0	0.0	0.0		
11:30	0.020	0.014	0.020	0.045	0.0	0.0	0.0	0.0		
11:45	0.025	0.017	0.024	0.049	0.0	0.0	0.0	0.0		
12:00	0.027	0.018	0.026	0.050	0.0	0.0	0.0	0.0		
12:15	0.028	0.019	0.028	0.054	0.0	0.0	0.0	0.0		
12:30	0.027	0.019	0.027	0.051	0.0	0.0	0.0	0.0		
12:45	0.026	0.017	0.025	0.050	0.4	0.0	0.5	0.5		
13:00	0.026	0.016	0.023	0.049	0.6	0.0	0.6	0.7		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.008	0.009	0.008	0.033	0.0	0.0	0.0	0.0		
13:30	0.008	0.008	0.008	0.034	0.0	0.0	0.0	0.0		
13:45	0.009	0.009	0.008	0.035	0.0	0.0	0.0	0.0		
14:00	0.008	0.008	0.009	0.033	0.0	0.0	0.0	0.0		
14:15	0.008	0.008	0.008	0.032	0.0	0.0	0.0	0.0		
14:30	0.008	0.008	0.008	0.032	0.0	0.0	0.0	0.0		
14:45	0.009	0.009	0.012	0.036	0.0	0.0	0.0	0.0		
15:00	0.010	0.009	0.010	0.034	0.0	0.0	0.0	0.0		
15:15	0.008	0.009	0.009	0.033	0.0	0.0	0.0	0.0		
15:30	0.008	0.009	0.008	0.032	0.0	0.0	0.0	0.0		
15:45	0.008	0.008	0.010	0.033	0.0	0.0	0.0	0.0		
16:00	0.008	0.008	0.009	0.035	0.0	0.0	0.0	0.0		
16:15	0.009	0.009	0.018	0.042	0.0	0.0	0.0	0.0		
16:30	0.011	0.009	0.020	0.045	0.0	0.0	0.0	0.0		
16:45	0.009	0.008	0.008	0.039	0.0	0.0	0.0	0.0		
17:00	0.009	0.008	0.013	0.056	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

- Soil/Fill disposal is summarized below:

Notes:
Soil from OU-2 only.
Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

- None

Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:00 am to 4:30 pm. The 15-minute average concentration of particulates exceeded action levels at CAMP Station 4 at 7:00 am and 7:45 am due to dry conditions and strong wind gusts. The contractor temporarily halted work and applied water to suppress dust. Particulate readings returned within the action threshold by 8:00 am. NYSDEC was notified of the two exceedances via email sent April 18 at 8:41 am. Dust particulate readings did not exceed the action threshold for the remainder of the day.

Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of site conditions, facing southwest.

GIS: \\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM




LEGEND

- PROPOSED ENDPOINT SAMPLE
- ▭ SITE BOUNDARY
- ▭ TAX LOT BOUNDARY
- ▭ NUHART EAST

- ▭ NUHART WEST
- ▭ APPROXIMATE WORK AREA
- CAMP STATION
- ▭ UST LOCATION

- NOTES**
 - ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
 - ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING
 - AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

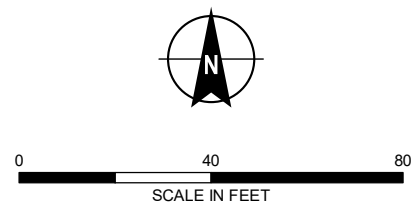

FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-18

Personnel : S. Sotomayor, A. Stewart
Weather : 48-60°F, Cloudy
Humidity : 46%
Wind Direction : SW to NE

Particulate Background (mg/m³) : 0.009
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.060	0.009	0.038	0.222	0.0	0.0	0.0	0.0		The 15-minute average concentration of particulates exceeded action levels at CAMP Station 4 at 7:00am & 7:45am due to dry conditions and strong wind gusts. The contractor temporarily halted work and sprayed the surface of the site with water to suppress dust and particulate readings returned within the action threshold by 8:00 am. NYSDEC notified of the two exceedances via email sent April 18 at 8:41 am.
07:15	0.027	0.009	0.025	0.096	0.0	0.0	0.0	0.0		
07:30	0.018	0.008	0.018	0.142	0.0	0.0	0.0	0.0		
07:45	0.016	0.008	0.018	0.161	0.0	0.0	0.0	0.0		
08:00	0.014	0.008	0.011	0.083	0.0	0.0	0.0	0.0		
08:15	0.012	0.008	0.014	0.086	0.0	0.0	0.0	0.0		
08:30	0.012	0.009	0.019	0.099	0.0	0.0	0.0	0.0		
08:45	0.011	0.009	0.010	0.062	0.0	0.0	0.0	0.0		
09:00	0.010	0.009	0.008	0.060	0.0	0.0	0.0	0.0		
09:15	0.012	0.010	0.012	0.056	0.0	0.0	0.0	0.0		
09:30	0.010	0.009	0.014	0.057	0.0	0.0	0.0	0.0		
09:45	0.011	0.009	0.010	0.049	0.0	0.0	0.0	0.0		
10:00	0.012	0.010	0.009	0.048	0.0	0.0	0.0	0.0		
10:15	0.023	0.008	0.009	0.038	0.0	0.0	0.0	0.0		
10:30	0.013	0.009	0.010	0.043	0.0	0.0	0.0	0.0		
10:45	0.012	0.009	0.010	0.049	0.0	0.0	0.0	0.0		
11:00	0.013	0.010	0.014	0.087	0.0	0.0	0.0	0.1		
11:15	0.014	0.023	0.034	0.078	0.0	0.0	0.0	0.1		
11:30	0.013	0.012	0.040	0.075	0.0	0.0	0.0	0.1		
11:45	0.015	0.011	0.018	0.081	0.0	0.0	0.0	0.1		
12:00	0.014	0.009	0.015	0.067	0.0	0.0	0.0	0.1		
12:15	0.014	0.009	0.018	0.055	0.0	0.0	0.0	0.0		
12:30	0.013	0.008	0.009	0.046	0.0	0.0	0.0	0.0		
12:45	0.014	0.010	0.012	0.045	0.0	0.0	0.0	0.0		
13:00	0.014	0.009	0.015	0.047	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.013	0.009	0.012	0.040	0.0	0.0	0.0	0.0		
13:30	0.014	0.009	0.011	0.040	0.0	0.0	0.0	0.0		
13:45	0.013	0.010	0.011	0.046	0.0	0.0	0.0	0.1		
14:00	0.013	0.010	0.014	0.049	0.0	0.0	0.0	0.0		
14:15	0.012	0.010	0.012	0.040	0.0	0.0	0.0	0.0		
14:30	0.011	0.009	0.011	0.040	0.0	0.0	0.0	0.0		
14:45	0.011	0.009	0.011	0.038	0.0	0.0	0.0	0.0		
15:00	0.011	0.010	0.010	0.038	0.0	0.0	0.0	0.0		
15:15	0.010	0.008	0.011	0.037	0.0	0.0	0.0	0.0		
15:30	0.009	0.008	0.009	0.036	0.0	0.0	0.0	0.0		
15:45	0.009	0.008	0.009	0.036	0.0	0.0	0.0	0.0		
16:00	0.009	0.009	0.009	0.035	0.0	0.0	0.0	0.0		
16:15	0.009	0.009	0.013	0.039	0.0	0.0	0.0	0.0		
16:30	0.009	0.008	0.009	0.038	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

- Soil/Fill disposal is summarized below:

Notes:
Soil from OU-2 only.
Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

- None

Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:00 am to 5:30 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:



Photo 1: View of site conditions, facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Fomer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM



LEGEND

PROPOSED ENDPOINT SAMPLE

NUHART WEST

SITE BOUNDARY

APPROXIMATE WORK AREA

TAX LOT BOUNDARY

CAMP STATION


NUHART EAST

UST LOCATION

- NOTES**
1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.

2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING

3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

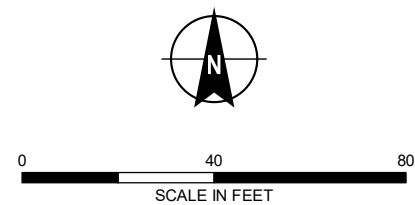

FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-19

Personnel : S. Sotomayor, A. Stewart
Weather : 50-63°F, Cloudy
Humidity : 49%
Wind Direction : SW to NE

Particulate Background (mg/m³) : 0.009
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.019	0.009	0.018	0.045	0.0	0.0	0.0	0.0		
07:15	0.015	0.009	0.011	0.041	0.0	0.0	0.0	0.0		
07:30	0.011	0.008	0.009	0.042	0.0	0.0	0.0	0.0		
07:45	0.011	0.008	0.008	0.042	0.0	0.0	0.0	0.0		
08:00	0.011	0.009	0.013	0.045	0.0	0.0	0.0	0.0		
08:15	0.011	0.009	0.008	0.045	0.0	0.0	0.0	0.0		
08:30	0.012	0.008	0.008	0.041	0.0	0.0	0.0	0.0		
08:45	0.010	0.010	0.008	0.046	0.0	0.0	0.0	0.0		
09:00	0.010	0.008	0.009	0.044	0.0	0.0	0.0	0.0		
09:15	0.010	0.009	0.009	0.044	0.0	0.0	0.0	0.0		
09:30	0.009	0.009	0.010	0.038	0.0	0.0	0.0	0.0		
09:45	0.009	0.009	0.010	0.039	0.0	0.0	0.0	0.0		
10:00	0.010	0.008	0.008	0.036	0.0	0.0	0.0	0.0		
10:15	0.009	0.008	0.009	0.039	0.0	0.0	0.0	0.0		
10:30	0.004	0.001	0.004	0.007	0.0	0.0	0.0	0.0		
10:45	0.004	0.001	0.003	0.005	0.0	0.0	0.0	0.0		
11:00	0.004	0.001	0.007	0.006	0.0	0.0	0.0	0.0		
11:15	0.003	0.002	0.004	0.004	0.0	0.0	0.0	0.0		
11:30	0.003	0.002	0.004	0.004	0.0	0.0	0.0	0.0		
11:45	0.004	0.001	0.004	0.010	0.0	0.0	0.0	0.0		
12:00	0.005	0.002	0.005	0.006	0.0	0.0	0.0	0.0		
12:15	0.005	0.002	0.008	0.007	0.0	0.0	0.0	0.0		
12:30	0.005	0.002	0.006	0.004	0.0	0.0	0.0	0.0		
12:45	0.004	0.001	0.007	0.007	0.0	0.0	0.0	0.0		
13:00	0.004	0.002	0.005	0.006	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.004	0.001	0.023	0.004	0.0	0.0	0.0	0.0		
13:30	0.004	0.002	0.011	0.002	0.0	0.0	0.0	0.0		
13:45	0.004	0.002	0.010	0.004	0.0	0.0	0.0	0.0		
14:00	0.003	0.002	0.006	0.007	0.0	0.0	0.0	0.0		
14:15	0.004	0.001	0.005	0.006	0.0	0.0	0.0	0.0		
14:30	0.003	0.001	0.008	0.003	0.0	0.0	0.0	0.0		
14:45	0.004	0.002	0.005	0.003	0.0	0.0	0.0	0.0		
15:00	0.003	0.001	0.006	0.004	0.0	0.0	0.0	0.0		
15:15	0.003	0.001	0.005	0.002	0.0	0.0	0.0	0.0		
15:30	0.003	0.002	0.011	0.001	0.0	0.0	0.0	0.0		
15:45	0.003	0.001	0.004	0.002	0.0	0.0	0.0	0.0		
16:00	0.003	0.001	0.004	0.004	0.0	0.0	0.0	0.0		
16:15	0.003	0.001	0.004	0.004	0.0	0.0	0.0	0.0		
16:30	0.003	0.002	0.020	0.006	0.0	0.0	0.0	0.0		
16:45	0.004	0.001	0.009	0.014	0.0	0.0	0.0	0.0		
17:00	0.005	0.001	0.005	0.015	0.0	0.0	0.0	0.0		
17:15	0.004	0.001	0.006	0.008	0.0	0.0	0.0	0.0		
17:30	0.004	0.001	0.004	0.002	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

- Soil/Fill disposal is summarized below:

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

- None

Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:00 am to 5:15 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:



Photo 1: View of site conditions, facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM




LEGEND

- | | |
|----------------------------|---------------------------|
| ● PROPOSED ENDPOINT SAMPLE | NUHART WEST |
| --- SITE BOUNDARY | --- APPROXIMATE WORK AREA |
| --- TAX LOT BOUNDARY | ● CAMP STATION |
| --- NUHART EAST | --- UST LOCATION |

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING
3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



**HALEY
ALDRICH**

FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-20

Personnel : S. Sotomayor, A. Stewart
Weather : 52-61°F, Sunny
Humidity : 58%
Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.004
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.012	0.004	0.029	0.008	0.0	0.0	0.0	0.0		
07:15	0.017	0.003	0.012	0.005	0.0	0.0	0.0	0.0		
07:30	0.013	0.007	0.020	0.005	0.0	0.0	0.0	0.0		
07:45	0.012	0.004	0.008	0.006	0.0	0.0	0.0	0.0		
08:00	0.011	0.003	0.009	0.008	0.0	0.0	0.0	0.0		
08:15	0.010	0.004	0.008	0.007	0.0	0.0	0.0	0.0		
08:30	0.011	0.003	0.006	0.008	0.1	0.0	0.0	0.0		
08:45	0.012	0.003	0.006	0.009	0.1	0.0	0.0	0.0		
09:00	0.009	0.003	0.005	0.007	0.0	0.0	0.0	0.0		
09:15	0.010	0.003	0.008	0.007	0.0	0.0	0.0	0.0		
09:30	0.009	0.003	0.006	0.007	0.0	0.0	0.0	0.0		
09:45	0.009	0.003	0.007	0.007	0.0	0.0	0.0	0.0		
10:00	0.008	0.004	0.007	0.007	0.0	0.0	0.0	0.0		
10:15	0.008	0.004	0.009	0.007	0.0	0.0	0.0	0.0		
10:30	0.008	0.003	0.009	0.007	0.0	0.0	0.0	0.0		
10:45	0.009	0.003	0.008	0.007	0.0	0.0	0.0	0.0		
11:00	0.007	0.004	0.010	0.006	0.0	0.0	0.0	0.0		
11:15	0.009	0.004	0.009	0.008	0.0	0.0	0.0	0.0		
11:30	0.010	0.004	0.013	0.008	0.0	0.0	0.0	0.0		
11:45	0.009	0.005	0.012	0.013	0.0	0.0	0.0	0.0		
12:00	0.010	0.005	0.013	0.012	0.0	0.0	0.0	0.0		
12:15	0.010	0.005	0.011	0.014	0.0	0.0	0.0	0.0		
12:30	0.012	0.006	0.018	0.009	0.0	0.0	0.0	0.0		
12:45	0.012	0.006	0.012	0.010	0.0	0.0	0.0	0.0		
13:00	0.015	0.006	0.010	0.009	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.015	0.007	0.014	0.020	0.0	0.0	0.0	0.0		
13:30	0.014	0.007	0.013	0.038	0.0	0.0	0.0	0.2		
13:45	0.013	0.005	0.012	0.026	0.0	0.0	0.0	0.1		
14:00	0.012	0.005	0.010	0.023	0.0	0.0	0.0	0.1		
14:15	0.014	0.005	0.013	0.027	0.0	0.0	0.0	0.0		
14:30	0.013	0.005	0.011	0.020	0.0	0.0	0.0	0.0		
14:45	0.013	0.005	0.011	0.021	0.0	0.0	0.0	0.0		
15:00	0.012	0.005	0.010	0.022	0.0	0.0	0.0	0.0		
15:15	0.013	0.005	0.011	0.020	0.0	0.0	0.0	0.0		
15:30	0.011	0.005	0.013	0.016	0.0	0.0	0.0	0.0		
15:45	0.012	0.005	0.011	0.017	0.0	0.0	0.0	0.0		
16:00	0.012	0.005	0.010	0.021	0.0	0.0	0.0	0.0		
16:15	0.010	0.005	0.011	0.016	0.0	0.0	0.0	0.0		
16:30	0.010	0.004	0.017	0.012	0.0	0.0	0.0	0.0		
16:45	0.010	0.004	0.009	0.010	0.0	0.0	0.0	0.0		
17:00	0.010	0.005	0.009	0.012	0.0	0.0	0.0	0.0		
17:15	0.009	0.004	0.009	0.017	0.0	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	178
NYSDEC Site	NYSDEC Site 224136	Date	4/21/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	54-63°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc.	Wind Direction	From NE to SW up to 6 mph
Weather	Sunny	Personnel on Site	S. Sotomayor, M. Boland
Humidity	63%	Time on Site	7:00am to 5:45pm

Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor drilling through sheet pile obstructions in southwest corner of the site.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ												Totals:	
Today:	Loads 0	Tons 0											Loads 0	Tons 0
Total:	15	180											15	180

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:00am to 5:30pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:


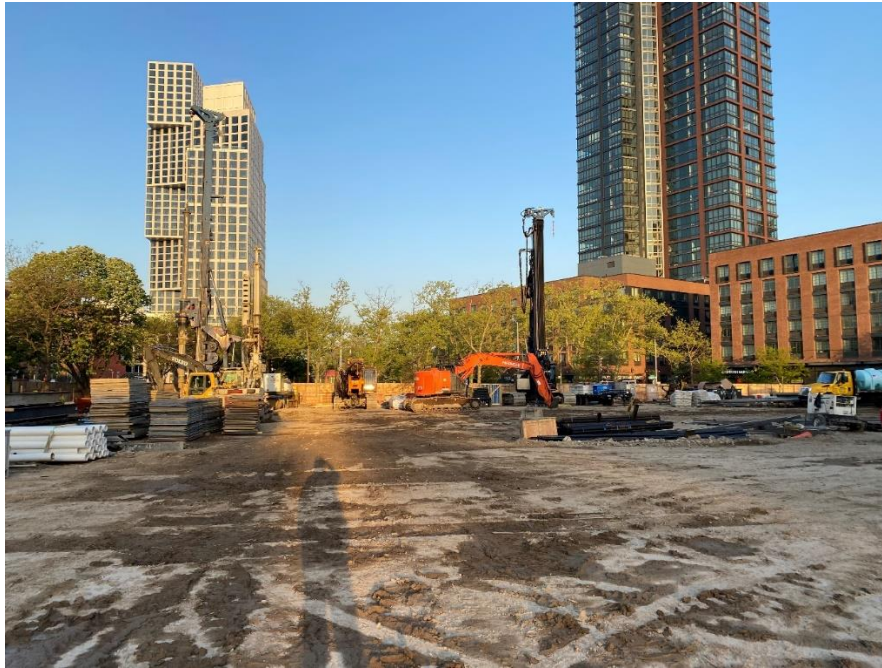


Photo 1: View of site conditions, facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\2021\891\GIS\Maps\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM

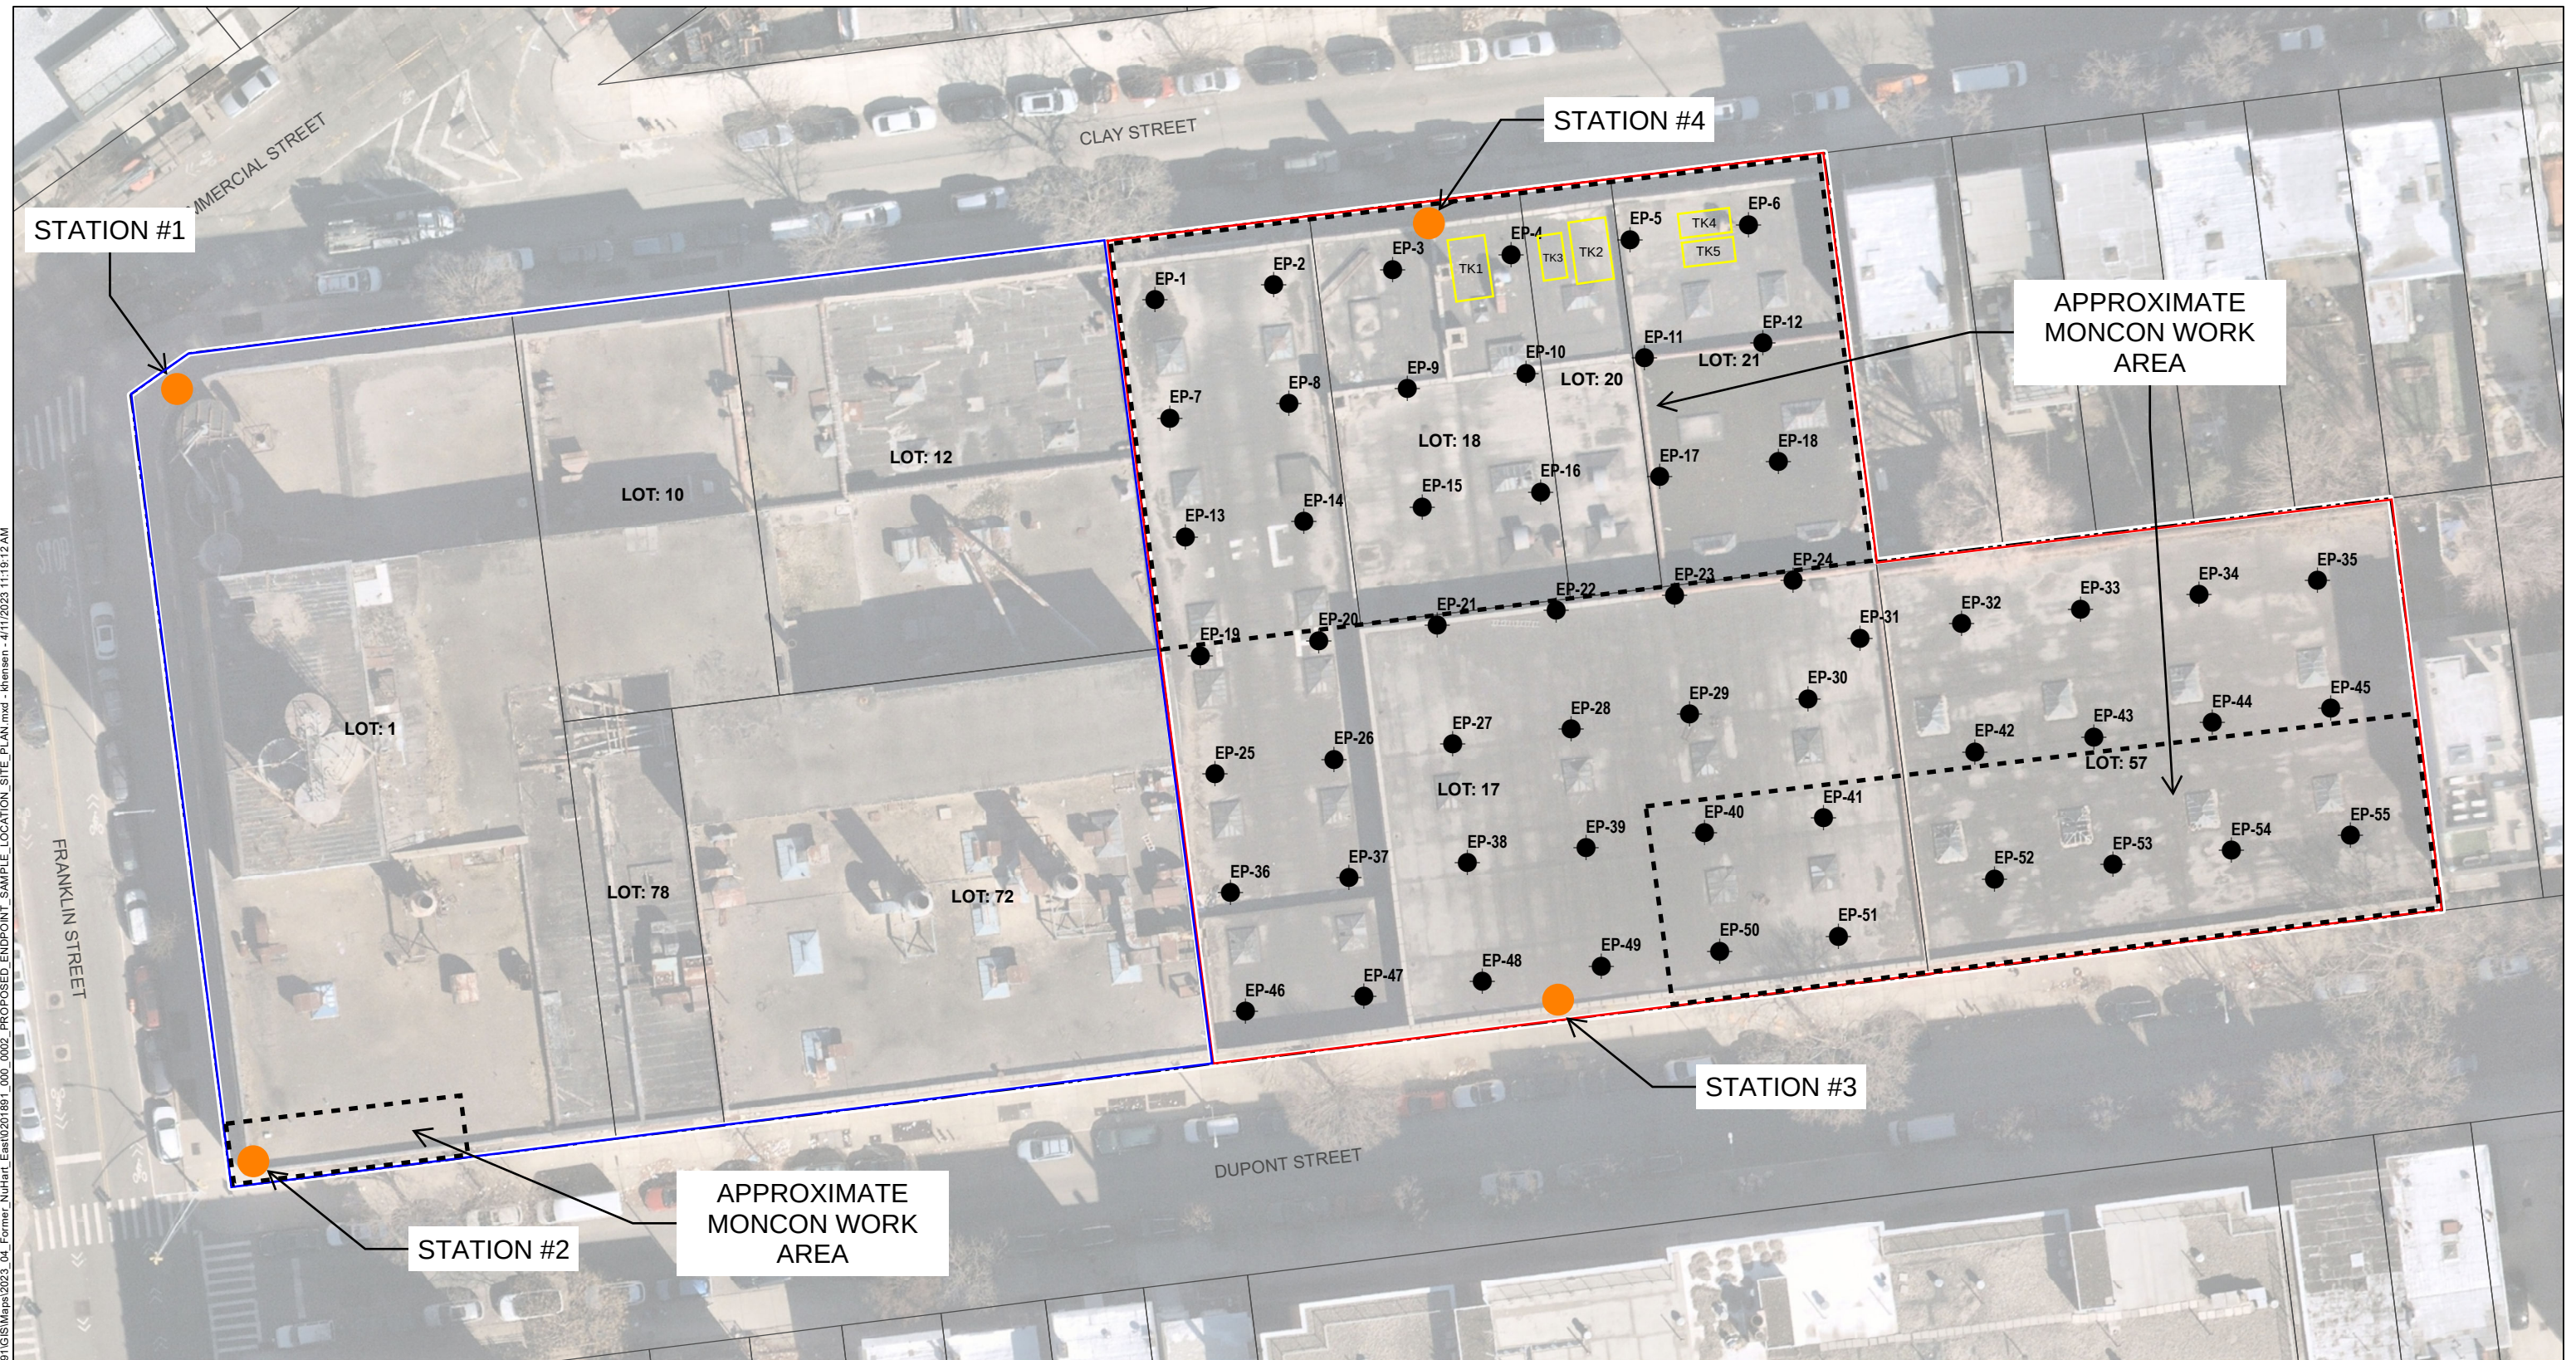

LEGEND

PROPOSED ENDPOINT SAMPLE

SITE BOUNDARY

TAX LOT BOUNDARY

NUHART EAST

NUHART WEST

APPROXIMATE WORK AREA

CAMP STATION

UST LOCATION

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.

2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING

3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

H

ALEY

A

LD

R

IC

H

FORMER NUHART SITE

65, 75 DUPONT STREET

BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-21

Personnel : S. Sotomayor, M. Boland
Weather : 54-63°F, Sunny
Humidity : 63%
Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.006
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.012	0.006	0.013	0.013	0.0	0.0	0.0	0.0		
07:15	0.016	0.007	0.015	0.015	0.0	0.0	0.0	0.0		
07:30	0.016	0.009	0.021	0.016	0.0	0.0	0.0	0.0		
07:45	0.017	0.009	0.040	0.016	0.0	0.0	0.0	0.0		
08:00	0.017	0.009	0.060	0.016	0.0	0.0	0.1	0.0		
08:15	0.015	0.010	0.024	0.042	0.0	0.0	0.0	0.0		
08:30	0.014	0.008	0.020	0.023	0.0	0.0	0.0	0.0		
08:45	0.015	0.007	0.027	0.028	0.0	0.0	0.0	0.0		
09:00	0.013	0.035	0.019	0.017	0.0	0.0	0.0	0.0		
09:15	0.012	0.007	0.017	0.033	0.0	0.0	0.0	0.0		
09:30	0.011	0.005	0.012	0.018	0.0	0.0	0.0	0.0		
09:45	0.011	0.006	0.012	0.017	0.0	0.0	0.0	0.0		
10:00	0.008	0.023	0.019	0.022	0.0	0.0	0.0	0.0		
10:15	0.012	0.008	0.022	0.018	0.0	0.0	0.0	0.0		
10:30	0.007	0.008	0.014	0.019	0.0	0.0	0.0	0.0		
10:45	0.007	0.007	0.010	0.013	0.0	0.1	0.0	0.0		
11:00	0.007	0.005	0.015	0.018	0.0	0.1	0.0	0.0		
11:15	0.014	0.005	0.008	0.011	0.0	0.0	0.0	0.0		
11:30	0.007	0.004	0.008	0.022	0.0	0.1	0.0	0.0		
11:45	0.007	0.009	0.010	0.016	0.0	0.0	0.0	0.0		
12:00	0.007	0.005	0.008	0.011	0.0	0.0	0.0	0.0		
12:15	0.007	0.005	0.008	0.010	0.0	0.1	0.0	0.0		
12:30	0.006	0.005	0.009	0.008	0.0	0.1	0.0	0.0		
12:45	0.005	0.003	0.005	0.009	0.0	0.0	0.0	0.0		
13:00	0.005	0.002	0.005	0.006	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.007	0.006	0.008	0.007	0.0	0.1	0.0	0.0		
13:30	0.006	0.009	0.013	0.012	0.0	0.0	0.0	0.1		
13:45	0.007	0.006	0.007	0.031	0.0	0.0	0.0	0.0		
14:00	0.007	0.006	0.006	0.028	0.0	0.0	0.0	0.0		
14:15	0.009	0.005	0.008	0.031	0.0	0.0	0.0	0.1		
14:30	0.010	0.006	0.008	0.031	0.0	0.0	0.0	0.0		
14:45	0.010	0.007	0.007	0.028	0.0	0.0	0.0	0.0		
15:00	0.010	0.007	0.017	0.040	0.0	0.0	0.0	0.0		
15:15	0.011	0.006	0.007	0.025	0.0	0.0	0.0	0.0		
15:30	0.009	0.005	0.006	0.005	0.0	0.0	0.0	0.0		
15:45	0.009	0.008	0.006	0.009	0.0	0.0	0.0	0.0		
16:00	0.010	0.010	0.005	0.023	0.0	0.0	0.0	0.0		
16:15	0.009	0.008	0.006	0.017	0.0	0.0	0.0	0.0		
16:30	0.010	0.008	0.006	0.014	0.0	0.0	0.0	0.0		
16:45	0.009	0.007	0.019	0.027	0.0	0.0	0.0	0.1		
17:00	0.010	0.006	0.019	0.010	0.0	0.0	0.0	0.0		
17:15	0.009	0.004	0.007	0.012	0.0	0.0	0.0	0.0		
17:30	0.010	0.004	0.010	0.010	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor cleared obstructions and installed sheet piles along southwest corner of the site.
- Contractor completed utility work in the sidewalk and street on Dupont Street.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Material Export:

- [illegible]

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

- None

- None

Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:00am to 6:30pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.


Site Photographs:

Photo 1: View of asphalt leveling over completed street excavation, facing south.



Photo 2: View of sheet pile installation, facing southwest.


GIS: \\haleyaldrich.com\share\CP\Projects\2021\891\GIS\Maps\2023_04_Fomer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM

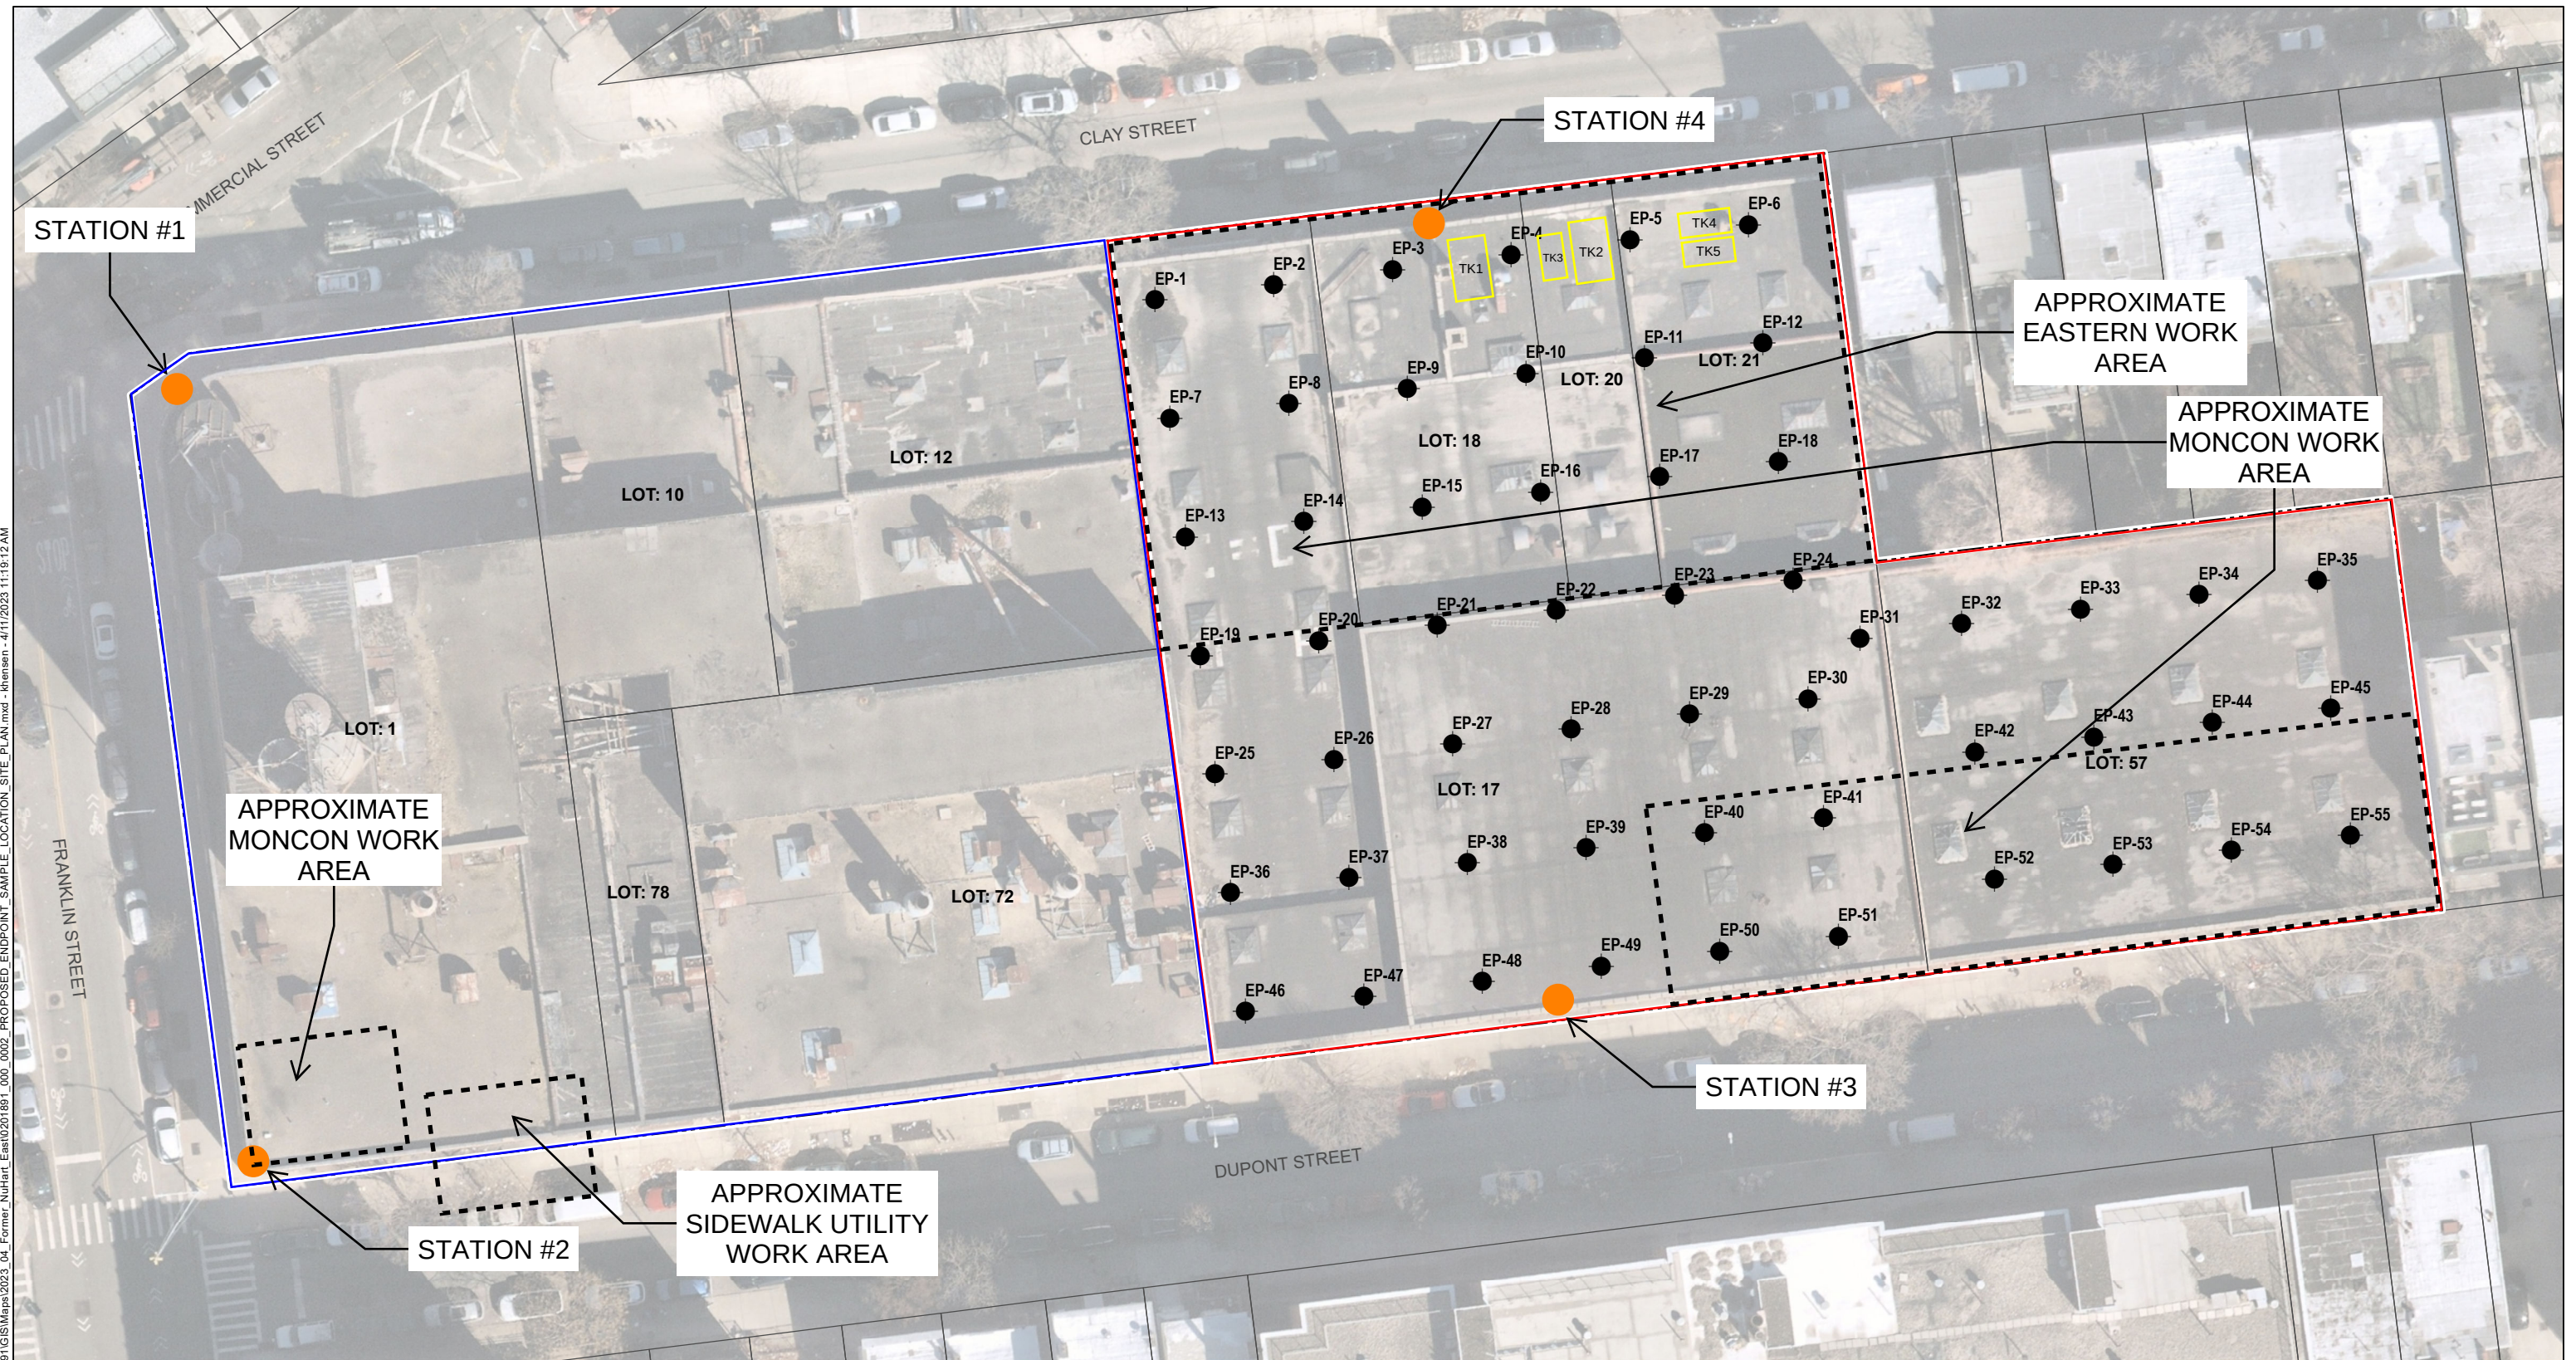

LEGEND

● PROPOSED ENDPOINT SAMPLE	□ NUHART WEST
□ SITE BOUNDARY	□ APPROXIMATE WORK AREA
□ TAX LOT BOUNDARY	● CAMP STATION
□ NUHART EAST	□ UST LOCATION

- NOTES**
1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
 2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING
 3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

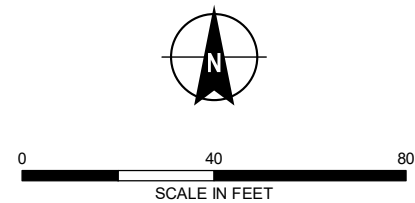

HALEY ALDRICH FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-24

Personnel : S. Sotomayor, S. Commisso, A. Stewart
Weather : 46-58°F, Sunny
Humidity : 68%
Wind Direction : NW to SE

Particulate Background (mg/m³) : 0.003
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.003	0.002	0.004	0.005	0.0	0.0	0.0	0.0		
07:15	0.007	0.002	0.004	0.005	0.0	0.0	0.0	0.0		
07:30	0.005	0.002	0.005	0.007	0.0	0.0	0.0	0.0		
07:45	0.005	0.002	0.005	0.007	0.0	0.0	0.0	0.0		
08:00	0.004	0.002	0.006	0.008	0.0	0.0	0.0	0.0		
08:15	0.005	0.001	0.005	0.008	0.0	0.0	0.0	0.0		
08:30	0.005	0.001	0.005	0.008	0.0	0.0	0.0	0.0		
08:45	0.005	0.002	0.006	0.007	0.0	0.0	0.0	0.0		
09:00	0.005	0.001	0.005	0.007	0.0	0.0	0.0	0.0		
09:15	0.004	0.002	0.005	0.007	0.0	0.0	0.0	0.0		
09:30	0.005	0.001	0.005	0.007	0.0	0.0	0.0	0.0		
09:45	0.004	0.001	0.005	0.005	0.0	0.0	0.0	0.0		
10:00	0.004	0.001	0.005	0.006	0.0	0.0	0.0	0.0		
10:15	0.004	0.001	0.006	0.005	0.0	0.0	0.0	0.0		
10:30	0.003	0.001	0.006	0.005	0.0	0.0	0.0	0.0		
10:45	0.003	0.001	0.006	0.005	0.0	0.0	0.0	0.0		
11:00	0.004	0.001	0.006	0.005	0.0	0.0	0.0	0.0		
11:15	0.003	0.001	0.009	0.006	0.0	0.0	0.0	0.0		
11:30	0.003	0.002	0.006	0.018	0.0	0.0	0.0	0.0		
11:45	0.005	0.002	0.006	0.020	0.0	0.0	0.0	0.0		
12:00	0.003	0.001	0.005	0.006	0.0	0.0	0.0	0.0		
12:15	0.003	0.002	0.004	0.008	0.0	0.0	0.0	0.0		
12:30	0.003	0.002	0.004	0.016	0.0	0.0	0.0	0.0		
12:45	0.002	0.001	0.003	0.007	0.0	0.0	0.0	0.0		
13:00	0.002	0.001	0.004	0.003	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.002	0.002	0.004	0.007	0.0	0.0	0.0	0.0		
13:30	0.002	0.002	0.005	0.007	0.0	0.0	0.0	0.0		
13:45	0.002	0.003	0.003	0.007	0.0	0.0	0.0	0.0		
14:00	0.002	0.008	0.003	0.005	0.0	0.0	0.0	0.0		
14:15	0.002	0.008	0.004	0.009	0.0	0.3	0.0	0.0		
14:30	0.003	0.006	0.004	0.008	0.0	0.2	0.0	0.0		
14:45	0.002	0.002	0.004	0.013	0.0	0.0	0.0	0.2		
15:00	0.003	0.003	0.004	0.010	0.0	0.0	0.0	0.1		
15:15	0.003	0.001	0.005	0.008	0.0	0.0	0.0	0.0		
15:30	0.002	0.001	0.003	0.005	0.0	0.0	0.0	0.0		
15:45	0.002	0.001	0.003	0.004	0.0	0.0	0.0	0.0		
16:00	0.002	0.001	0.002	0.004	0.0	0.0	0.0	0.0		
16:15	0.003	0.001	0.003	0.006	0.0	0.0	0.0	0.0		
16:30	0.002	0.003	0.003	0.010	0.0	0.0	0.0	0.0		
16:45	0.003	0.005	0.002	0.003	0.0	0.0	0.0	0.0		
17:00	0.003	0.007	0.002	0.013	0.0	0.0	0.0	0.0		
17:15	0.002	0.011	0.004	0.007	0.0	0.0	0.0	0.0		
17:30	0.002	0.009	0.003	0.014	0.0	0.0	0.0	0.0		
17:45	0.003	0.018	0.003	0.017	0.0	0.0	0.0	0.0		
18:00	0.004	0.006	0.003	0.006	0.1	0.0	0.0	0.0		
18:15	0.003	0.032	0.003	0.009	0.0	0.0	0.0	0.0		
18:30	0.003	0.040	0.004	0.009	0.0	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	178
NYSDEC Site	NYSDEC Site 224136	Date	4/25/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	55-62°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc.	Wind Direction	From N to S up to 5 mph
Weather	Sunny	Personnel on Site	S. Sotomayor, A. Stewart
Humidity	43%	Time on Site	7:00am to 5:15pm

Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street. Absorbent sock installed in MW-24.
- Contractor drilling through obstructions and installing sheet piles along southwest corner of the site.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ												Totals:	
Today:	Loads	Tons											Loads	Tons
	0	0											0	0
<u>Total:</u>	<u>15</u>	<u>180</u>											<u>15</u>	<u>180</u>

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report.

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:00 am to 5:00 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of sheet pile installation, facing southwest.

GIS: \\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Fomer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM



LEGEND

 PROPOSED ENDPOINT SAMPLE

 NUHART WEST

 SITE BOUNDARY

 APPROXIMATE WORK AREA

 TAX LOT BOUNDARY

 CAMP STATION

 NUHART EAST


 UST LOCATION

- NOTES**

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.

2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING

3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

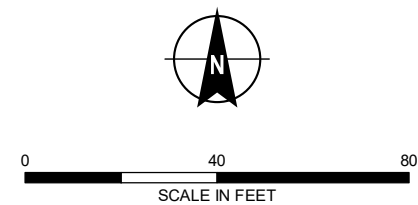



FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-25

Personnel : S. Sotomayor, A. Stewart
Weather : 55-62°F, Sunny
Humidity : 43%
Wind Direction : N to S

Particulate Background (mg/m³) : 0.002
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.004	0.002	0.003	0.005	0.0	0.0	0.0	0.0		
07:15	0.004	0.002	0.003	0.006	0.0	0.0	0.0	0.0		
07:30	0.005	0.004	0.003	0.006	0.0	0.0	0.0	0.0		
07:45	0.005	0.005	0.005	0.009	0.0	0.0	0.0	0.0		
08:00	0.004	0.007	0.003	0.007	0.0	0.0	0.0	0.0		
08:15	0.005	0.019	0.004	0.007	0.0	0.0	0.0	0.0		
08:30	0.006	0.017	0.004	0.006	0.0	0.0	0.0	0.0		
08:45	0.005	0.006	0.006	0.007	0.0	0.0	0.0	0.0		
09:00	0.004	0.007	0.004	0.006	0.0	0.0	0.0	0.0		
09:15	0.004	0.003	0.005	0.006	0.0	0.0	0.0	0.0		
09:30	0.004	0.002	0.004	0.006	0.0	0.0	0.0	0.0		
09:45	0.004	0.002	0.005	0.006	0.0	0.0	0.0	0.0		
10:00	0.004	0.003	0.004	0.006	0.0	0.0	0.0	0.0		
10:15	0.004	0.007	0.005	0.004	0.0	0.0	0.0	0.0		
10:30	0.004	0.004	0.005	0.004	0.0	0.0	0.0	0.0		
10:45	0.004	0.004	0.004	0.008	0.0	0.0	0.0	0.0		
11:00	0.004	0.004	0.005	0.006	0.0	0.0	0.0	0.0		
11:15	0.003	0.003	0.004	0.005	0.0	0.0	0.0	0.0		
11:30	0.003	0.003	0.004	0.006	0.0	0.0	0.0	0.0		
11:45	0.004	0.003	0.004	0.007	0.0	0.0	0.0	0.0		
12:00	0.003	0.003	0.004	0.006	0.0	0.0	0.0	0.0		
12:15	0.004	0.004	0.004	0.011	0.0	0.0	0.0	0.0		
12:30	0.003	0.007	0.004	0.009	0.0	0.1	0.0	0.0		
12:45	0.003	0.004	0.004	0.007	0.0	0.0	0.0	0.0		
13:00	0.004	0.001	0.003	0.011	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.004	0.004	0.005	0.015	0.0	0.0	0.0	0.0		
13:30	0.005	0.005	0.005	0.019	0.0	0.0	0.0	0.0		
13:45	0.005	0.004	0.005	0.010	0.0	0.2	0.0	0.0		
14:00	0.005	0.002	0.005	0.025	0.0	0.0	0.0	0.0		
14:15	0.006	0.012	0.006	0.008	0.0	0.0	0.0	0.0		
14:30	0.005	0.006	0.011	0.010	0.0	0.0	0.0	0.0		
14:45	0.005	0.009	0.005	0.006	0.0	0.0	0.0	0.0		
15:00	0.006	0.094	0.004	0.013	0.0	0.0	0.0	0.0		
15:15	0.009	0.014	0.004	0.012	0.0	0.0	0.0	0.0		
15:30	0.006	0.001	0.004	0.005	0.0	0.0	0.0	0.0		
15:45	0.003	0.001	0.003	0.005	0.0	0.0	0.0	0.0		
16:00	0.003	0.002	0.002	0.012	0.0	0.0	0.0	0.0		
16:15	0.003	0.017	0.003	0.005	0.0	0.0	0.0	0.0		
16:30	0.003	0.024	0.003	0.007	0.0	0.1	0.0	0.0		
16:45	0.003	0.004	0.003	0.016	0.0	0.0	0.0	0.0		
17:00	0.003	0.003	0.002	0.018	0.0	0.1	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	179
NYSDEC Site	NYSDEC Site 224136	Date	4/26/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	55-59°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc.	Wind Direction	From NE to SW up to 7 mph
Weather	Sunny	Personnel on Site	S. Sotomayor, A. Stewart
Humidity	54%	Time on Site	7:00am to 5:15pm

Haley & Aldrich of New York (Haley & Aldrich) was present to gauge accessible monitoring wells along Franklin and Dupont Street. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street.
- Contractor drilling through obstructions and installing sheet piles along southwest corner of the site.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ												Totals:	
Today:	Loads 0	Tons 0											Loads 0	Tons 0
Total:	15	180											15	180

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:00 am to 5:30 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.

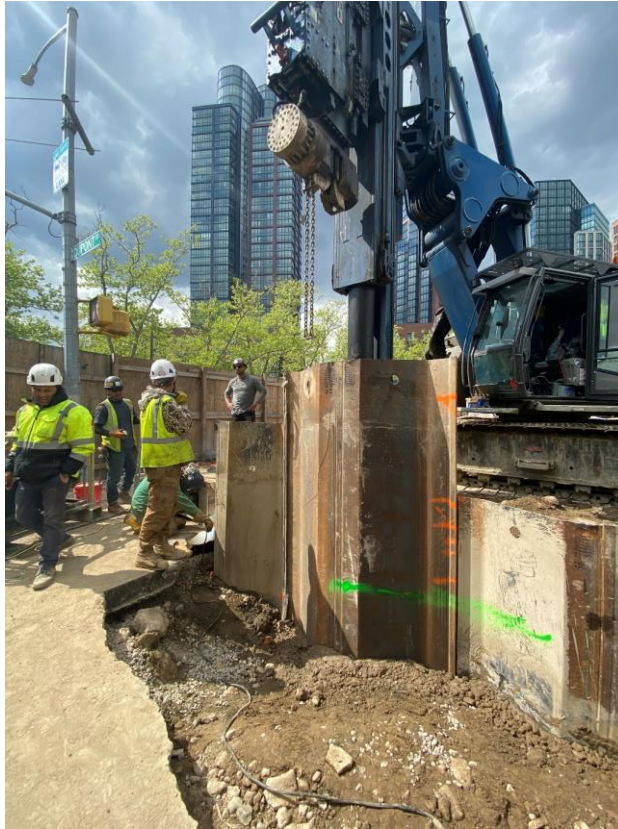
Site Photographs:

Photo 1: View of sheet pile installation, facing southwest.

GIS: \\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM



LEGEND

PROPOSED ENDPOINT SAMPLE

SITE BOUNDARY

TAX LOT BOUNDARY

NUHART EAST


NUHART WEST

APPROXIMATE WORK AREA

CAMP STATION

UST LOCATION

- NOTES**
1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
 2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING
 3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

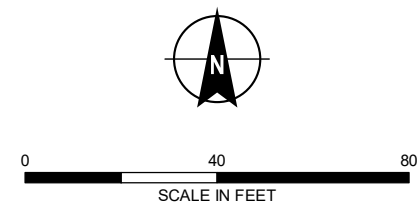

FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-26

Personnel : S. Sotomayor, A. Stewart
Weather : 55-59°F, Sunny
Humidity : 54%
Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.003
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.008	0.003	0.004	0.010	0.0	0.0	0.0	0.0		
07:15	0.008	0.005	0.005	0.013	0.0	0.1	0.0	0.0		
07:30	0.008	0.004	0.005	0.012	0.0	0.0	0.0	0.0		
07:45	0.007	0.005	0.004	0.006	0.0	0.0	0.0	0.0		
08:00	0.006	0.005	0.006	0.008	0.0	0.0	0.0	0.0		
08:15	0.007	0.002	0.005	0.007	0.0	0.0	0.0	0.0		
08:30	0.007	0.003	0.008	0.012	0.0	0.0	0.0	0.0		
08:45	0.006	0.003	0.008	0.008	0.0	0.0	0.0	0.0		
09:00	0.008	0.004	0.007	0.010	0.0	0.0	0.0	0.0		
09:15	0.007	0.003	0.007	0.012	0.0	0.0	0.0	0.0		
09:30	0.006	0.003	0.006	0.017	0.0	0.0	0.0	0.0		
09:45	0.006	0.009	0.007	0.008	0.0	0.0	0.0	0.0		
10:00	0.006	0.005	0.007	0.014	0.0	0.0	0.0	0.0		
10:15	0.005	0.002	0.011	0.017	0.0	0.0	0.0	0.0		
10:30	0.004	0.002	0.012	0.009	0.0	0.0	0.0	0.0		
10:45	0.004	0.002	0.023	0.009	0.0	0.0	0.0	0.0		
11:00	0.005	0.002	0.013	0.013	0.0	0.0	0.0	0.0		
11:15	0.007	0.004	0.008	0.010	0.0	0.0	0.0	0.0		
11:30	0.006	0.002	0.010	0.008	0.0	0.0	0.0	0.0		
11:45	0.008	0.003	0.011	0.010	0.0	0.0	0.0	0.0		
12:00	0.008	0.004	0.007	0.008	0.0	0.0	0.0	0.0		
12:15	0.006	0.003	0.005	0.009	0.0	0.0	0.0	0.0		
12:30	0.006	0.002	0.005	0.008	0.0	0.0	0.0	0.0		
12:45	0.006	0.002	0.005	0.006	0.0	0.0	0.0	0.0		
13:00	0.008	0.002		0.004	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.006	0.003	0.014	0.009	0.0	0.0	0.0	0.0		
13:30	0.008	0.006	0.013	0.008	0.0	0.0	0.0	0.0		
13:45	0.006	0.003	0.014	0.009	0.0	0.0	0.0	0.0		
14:00	0.007	0.006	0.007	0.011	0.0	0.0	0.0	0.0		
14:15	0.010	0.011	0.012	0.006	0.0	0.0	0.0	0.0		
14:30	0.009	0.007	0.013	0.008	0.0	0.0	0.0	0.0		
14:45	0.007	0.007	0.013	0.006	0.0	0.0	0.0	0.0		
15:00	0.008	0.007	0.015	0.007	0.0	0.0	0.0	0.0		
15:15	0.012	0.013	0.010	0.008	0.0	0.1	0.0	0.0		
15:30	0.007	0.005	0.010	0.007	0.0	0.0	0.0	0.0		
15:45	0.007	0.005	0.007	0.011	0.0	0.0	0.0	0.0		
16:00	0.007	0.006	0.007	0.010	0.0	0.1	0.0	0.0		
16:15	0.007	0.006	0.008	0.007	0.0	0.0	0.0	0.0		
16:30	0.007	0.021	0.007	0.007	0.0	0.0	0.0	0.0		
16:45	0.008	0.004	0.007	0.006	0.0	0.0	0.0	0.0		
17:00	0.007	0.003	0.011	0.007	0.0	0.0	0.0	0.0		
17:15	0.007	0.003	0.008	0.005	0.0	0.0	0.0	0.0		
17:30	0.008	0.006	0.007	0.007	0.0	0.0	0.0	0.0		
17:45			0.006				0.0			

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	180
NYSDEC Site	NYSDEC Site 224136	Date	4/27/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	54-59°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc.	Wind Direction	From SE to NW up to 9 mph
Weather	Sunny	Personnel on Site	S. Sotomayor, A. Stewart
Humidity	66%	Time on Site	7:00am to 5:45pm

Haley & Aldrich of New York (Haley & Aldrich) was present to observe construction activities at the Site. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street.
- Contractor drilling through obstructions and installing sheet piles along southwest corner of the site.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	Clean Earth of Carteret, NJ												Totals:	
Today:	Loads 0	Tons 0											Loads 0	Tons 0
Total:	15	180											15	180

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:15 am to 5:45 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of sheet pile installation, facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\2021\891\GIS\Map\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM



LEGEND

PROPOSED ENDPOINT SAMPLE

SITE BOUNDARY

TAX LOT BOUNDARY

NUHART EAST

NUHART WEST

APPROXIMATE WORK AREA

CAMP STATION

UST LOCATION

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.

2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING

3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

H

ALEY

A

LD

R

I

C

H

FORMER NUHART SITE

65, 75 DUPONT STREET

BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-27

Personnel : S. Sotomayor, A. Stewart
Weather : 54-59°F, Sunny
Humidity : 66%
Wind Direction : SE to NW

Particulate Background (mg/m³) : 0.013
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:15	0.013	0.073	0.015	0.017	0.0	0.0	0.0	0.0		
07:30	0.010	0.007	0.011	0.012	0.0	0.0	0.0	0.0		
07:45	0.010	0.013	0.013	0.016	0.0	0.0	0.0	0.0		
08:00	0.009	0.011	0.012	0.013	0.0	0.0	0.0	0.0		
08:15	0.008	0.018	0.012	0.012	0.0	0.0	0.0	0.0		
08:30	0.009	0.023	0.017	0.011	0.0	0.0	0.0	0.0		
08:45	0.009	0.004	0.009	0.009	0.0	0.0	0.0	0.0		
09:00	0.008	0.005	0.010	0.010	0.0	0.0	0.0	0.0		
09:15	0.008	0.005	0.010	0.008	0.0	0.0	0.0	0.0		
09:30	0.008	0.004	0.011	0.008	0.0	0.0	0.0	0.0		
09:45	0.007	0.011	0.010	0.008	0.0	0.0	0.0	0.0		
10:00	0.008	0.018	0.010	0.008	0.0	0.0	0.0	0.0		
10:15	0.008	0.019	0.010	0.008	0.0	0.0	0.0	0.0		
10:30	0.007	0.015	0.011	0.008	0.0	0.0	0.0	0.0		
10:45	0.009	0.012	0.023	0.008	0.0	0.0	0.0	0.0		
11:00	0.008	0.015	0.026	0.009	0.0	0.0	0.0	0.0		
11:15	0.006	0.005	0.038	0.007	0.0	0.0	0.0	0.0		
11:30	0.006	0.014	0.024	0.007	0.0	0.0	0.0	0.0		
11:45	0.006	0.018	0.009	0.007	0.0	0.0	0.0	0.0		
12:00	0.006	0.010	0.011	0.007	0.0	0.0	0.1	0.0		
12:15	0.006	0.016	0.008	0.008	0.0	0.0	0.0	0.0		
12:30	0.006	0.005	0.007	0.008	0.0	0.0	0.0	0.0		
12:45	0.006	0.010	0.007	0.010	0.0	0.0	0.0	0.0		
13:00	0.006	0.007	0.008	0.007	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.007	0.004	0.009	0.008	0.0	0.0	0.0	0.0		
13:30	0.006	0.004	0.018	0.007	0.0	0.0	0.0	0.0		
13:45	0.007	0.007	0.012	0.007	0.0	0.0	0.0	0.0		
14:00	0.006	0.005	0.016	0.007	0.0	0.0	0.0	0.0		
14:15	0.006	0.009	0.016	0.006	0.0	0.0	0.0	0.0		
14:30	0.007	0.007	0.009	0.007	0.0	0.0	0.0	0.0		
14:45	0.006	0.006	0.011	0.008	0.0	0.0	0.0	0.0		
15:00	0.010	0.003	0.007	0.006	0.0	0.0	0.0	0.0		
15:15	0.005	0.003	0.005	0.006	0.0	0.0	0.0	0.0		
15:30	0.007	0.005	0.008	0.006	0.0	0.0	0.0	0.0		
15:45	0.013	0.017	0.006	0.007	0.0	0.0	0.0	0.0		
16:00	0.007	0.006	0.007	0.006	0.0	0.0	0.0	0.0		
16:15	0.007	0.004	0.009	0.006	0.0	0.0	0.0	0.0		
16:30	0.007	0.006	0.011	0.006	0.0	0.0	0.0	0.0		
16:45	0.008	0.008	0.010	0.006	0.0	0.0	0.0	0.0		
17:00	0.006	0.009	0.006	0.005	0.0	0.0	0.0	0.0		
17:15	0.005	0.005	0.010	0.005	0.0	0.0	0.0	0.0		
17:30	0.005	0.005	0.014	0.004	0.0	0.0	0.0	0.0		
17:45	0.005	0.004	0.007	0.005	0.0	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	181
NYSDEC Site	NYSDEC Site 224136	Date	4/28/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	50-59°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc.	Wind Direction	From NE to SW up to 9 mph
Weather	Sunny	Personnel on Site	S. Sotomayor, A. Stewart
Humidity	72%	Time on Site	7:00am to 5:45pm

Haley & Aldrich of New York (Haley & Aldrich) was present to observe construction activities at the Site. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street.
- Contractor drilling through obstructions and installing sheet piles along southwest corner of the site.
- Contractor pre-drilling for sheet pile installation along Dupont Street.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	<i>Clean Earth of Carteret, NJ</i>												<i>Totals:</i>	
<i>Today:</i>	Loads 0	Tons 0											Loads 0	Tons 0
<i>Total:</i>	<u>15</u>	<u>180</u>											<u>15</u>	<u>180</u>

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:15 am to 5:45 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of sheet pile installation, facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM



LEGEND

PROPOSED ENDPOINT SAMPLE

SITE BOUNDARY

TAX LOT BOUNDARY

NUHART EAST

NUHART WEST

APPROXIMATE WORK AREA

CAMP STATION

UST LOCATION

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.

2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING

3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

HALEY

ALDRICH

FORMER NUHART SITE

65, 75 DUPONT STREET

BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-28

Personnel : S. Sotomayor, A. Stewart
Weather : 50-59°F, Sunny
Humidity : 72%
Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.007
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00			0.015							
07:15	0.009	0.007	0.010	0.010	0.0	0.0	0.0	0.0		
07:30	0.007	0.008	0.017	0.008	0.0	0.0	0.0	0.0		
07:45	0.007	0.009	0.015	0.008	0.0	0.0	0.1	0.1		
08:00	0.007	0.008	0.016	0.008	0.0	0.0	0.0	0.0		
08:15	0.007	0.006	0.008	0.009	0.0	0.0	0.0	0.0		
08:30	0.007	0.006	0.009	0.010	0.0	0.0	0.0	0.0		
08:45	0.007	0.007	0.009	0.010	0.0	0.0	0.0	0.0		
09:00	0.007	0.006	0.010	0.009	0.0	0.0	0.1	0.0		
09:15	0.009	0.010	0.013	0.009	0.0	0.0	0.0	0.0		
09:30	0.007	0.008	0.008	0.008	0.0	0.0	0.0	0.0		
09:45	0.006	0.011	0.009	0.006	0.0	0.0	0.0	0.0		
10:00	0.009	0.019	0.009	0.007	0.0	0.0	0.1	0.0		
10:15	0.006	0.007	0.008	0.007	0.0	0.0	0.0	0.0		
10:30	0.007	0.009	0.008	0.007	0.0	0.0	0.0	0.0		
10:45	0.007	0.014	0.009	0.007	0.0	0.0	0.2	0.0		
11:00	0.005	0.009	0.011	0.008	0.0	0.0	0.2	0.0		
11:15	0.005	0.007	0.008	0.007	0.0	0.0	0.1	0.0		
11:30	0.016	0.006	0.008	0.007	0.0	0.0	0.0	0.0		
11:45	0.007	0.007	0.007	0.008	0.1	0.0	0.0	0.0		
12:00	0.007	0.006	0.010	0.008	0.0	0.0	0.0	0.0		
12:15	0.007	0.013	0.008	0.008	0.0	0.0	0.0	0.0		
12:30	0.008	0.015	0.013	0.009	0.0	0.0	0.0	0.0		
12:45	0.007	0.016	0.010	0.011	0.0	0.0	0.0	0.0		
13:00	0.007	0.007	0.009	0.008	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.010	0.008	0.012	0.006	0.0	0.0	0.0	0.0		
13:30	0.008	0.006	0.011	0.005	0.0	0.0	0.0	0.0		
13:45	0.008	0.009	0.008	0.005	0.0	0.0	0.0	0.0		
14:00	0.007	0.012	0.008	0.005	0.0	0.0	0.0	0.0		
14:15	0.008	0.013	0.008	0.006	0.0	0.0	0.0	0.0		
14:30	0.009	0.014	0.007	0.006	0.0	0.0	0.0	0.0		
14:45	0.010	0.018	0.007	0.006	0.1	0.0	0.0	0.0		
15:00	0.011	0.017	0.008	0.005	0.1	0.0	0.0	0.0		
15:15	0.012	0.018	0.010	0.006	0.0	0.0	0.0	0.0		
15:30	0.019	0.009	0.008	0.005	0.0	0.0	0.0	0.0		
15:45	0.014	0.015	0.008	0.006	0.0	0.0	0.0	0.0		
16:00	0.009	0.008	0.008	0.006	0.0	0.0	0.0	0.0		
16:15	0.008	0.008	0.006	0.005	0.1	0.0	0.0	0.0		
16:30	0.007	0.008	0.006	0.005	0.0	0.0	0.0	0.0		
16:45	0.007	0.020	0.005	0.005	0.0	0.0	0.0	0.0		
17:00	0.007	0.018	0.007	0.005	0.0	0.0	0.0	0.0		
17:15	0.027	0.008	0.008	0.005	0.0	0.0	0.0	0.0		
17:30	0.018	0.009	0.008	0.005	0.0	0.0	0.0	0.0		
17:45	0.032	0.005	0.007	0.005	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to observe construction activities at the Site. Site Observations are summarized below.

- Contractor drilling through obstructions and installing sheet piles along southeastern and northwestern portion of the site.
- Haley & Aldrich gauged accessible wells along Franklin and Dupont Street.

- Soil/Fill disposal is summarized below:

Notes:
Soil from OU-2 only.
Tonnage is approximate, final tonnages will be included in the Final Engineering Report

- None

- None


Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 9:30 am to 3:15 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of sheet pile installation, facing northwest.

GIS: \\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM

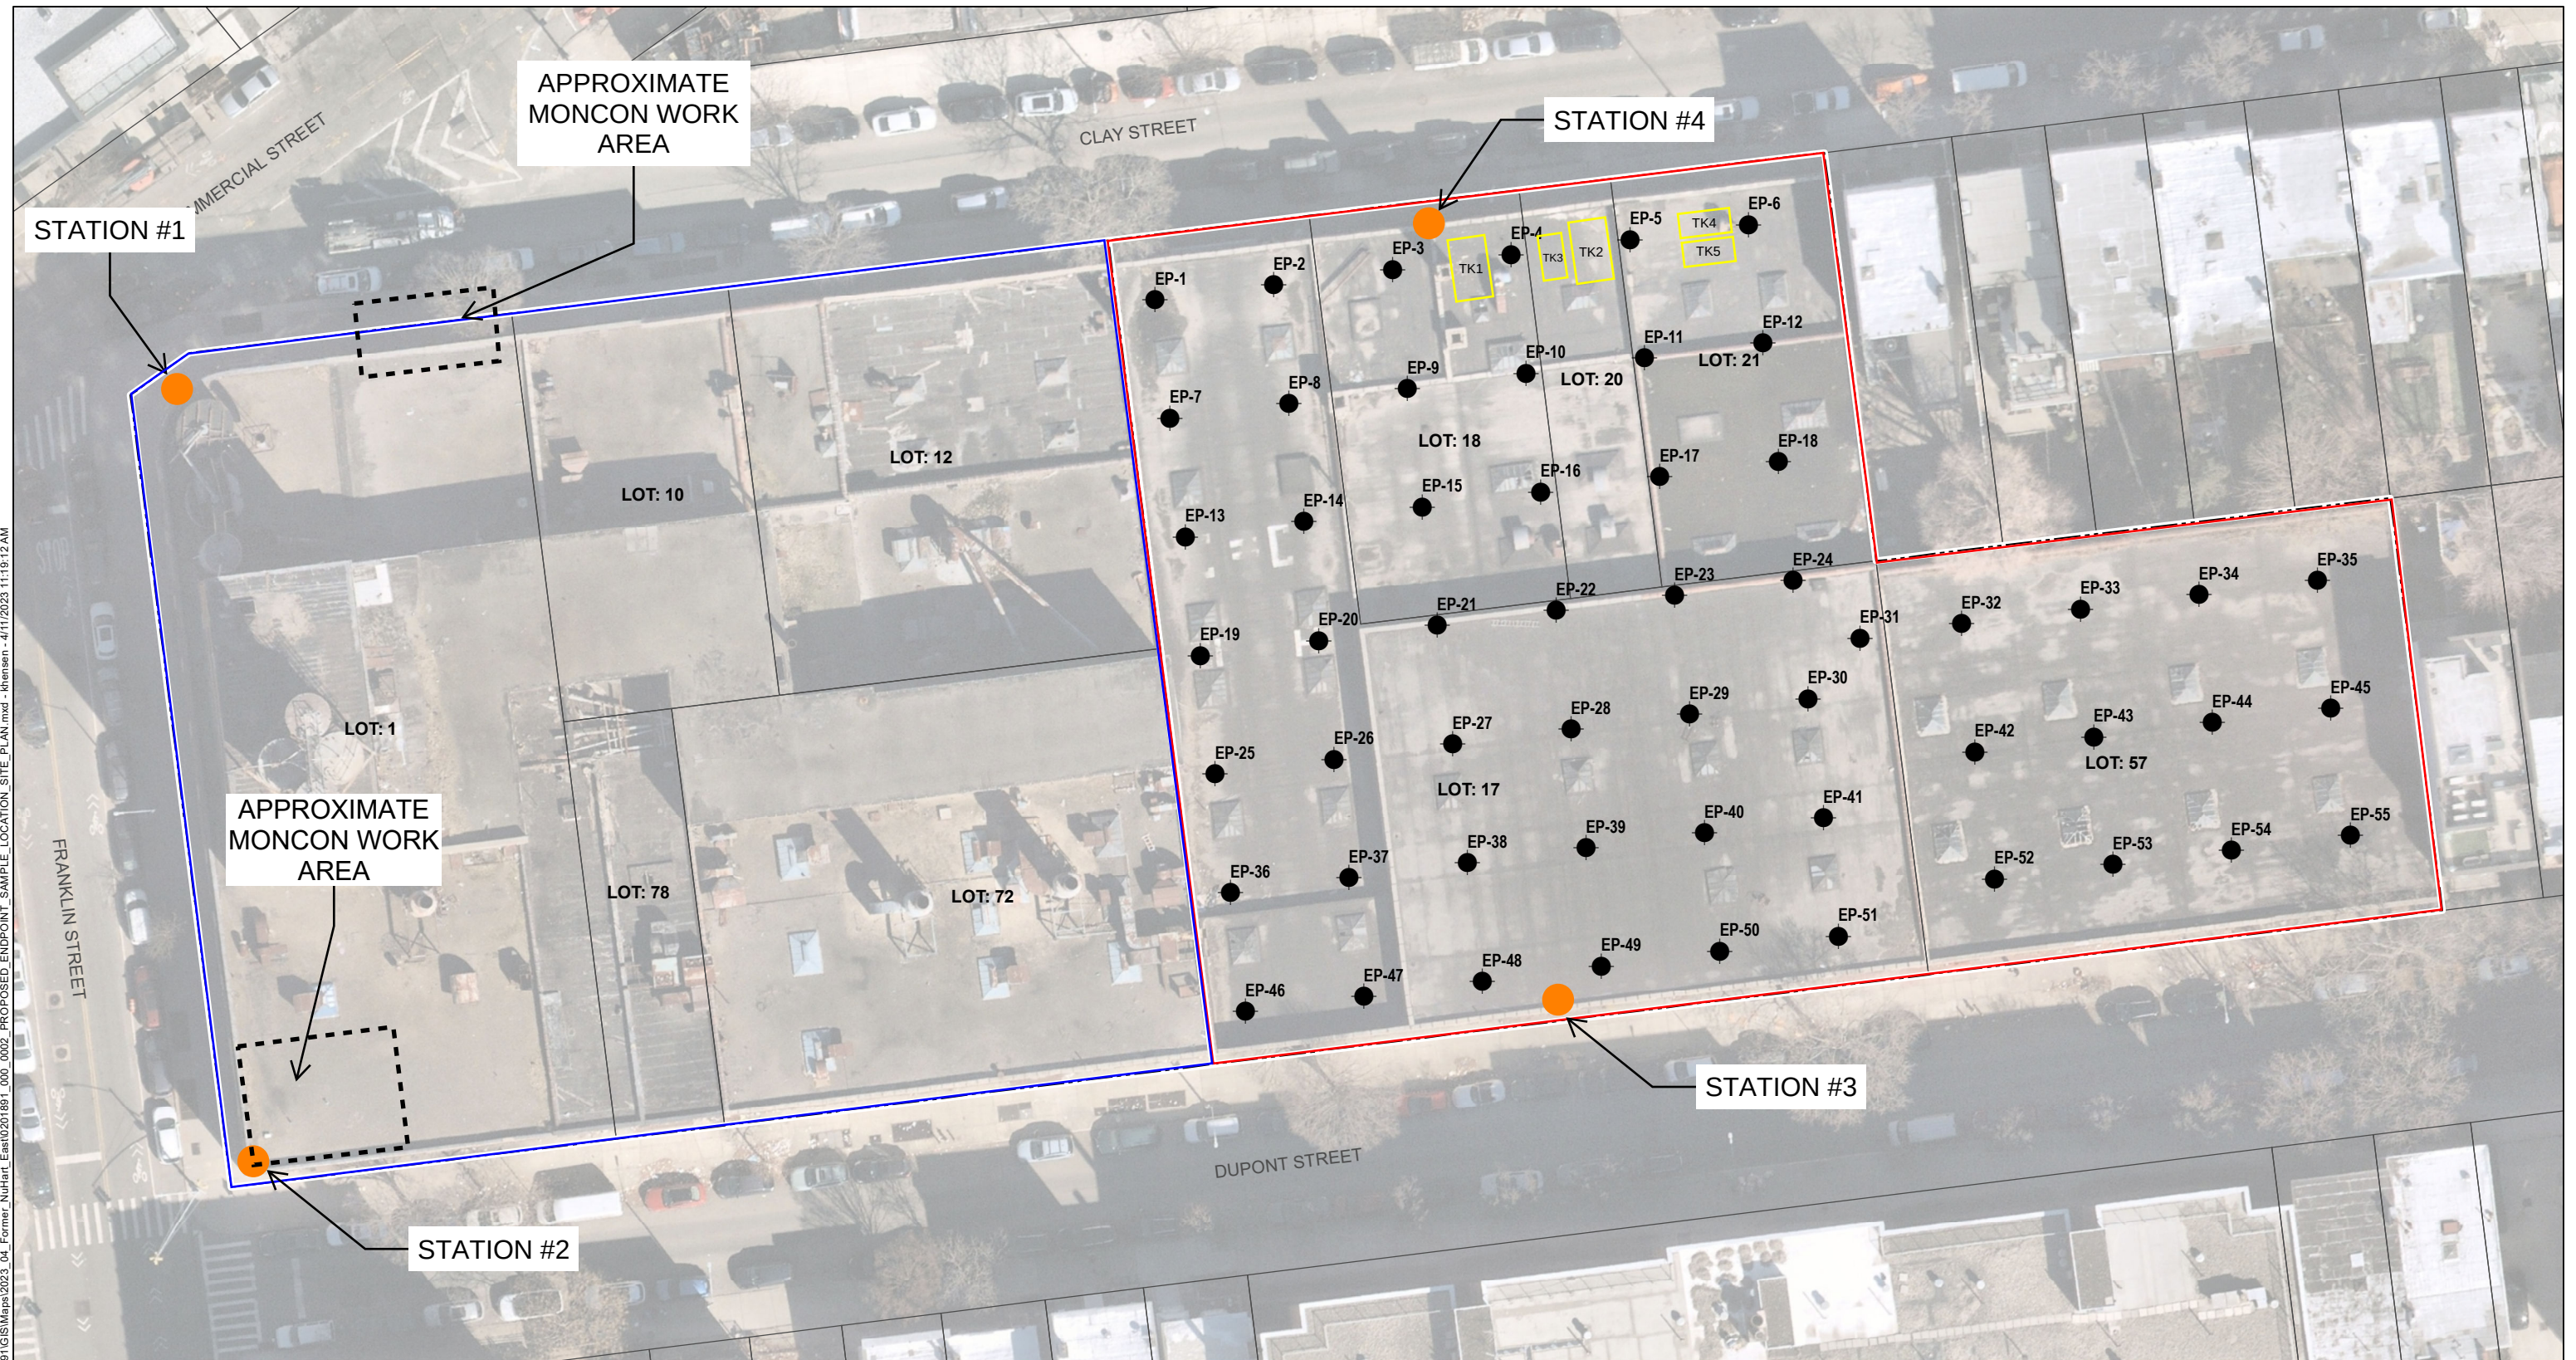

LEGEND

PROPOSED ENDPOINT SAMPLE

NUHART WEST

SITE BOUNDARY

APPROXIMATE WORK AREA

TAX LOT BOUNDARY

CAMP STATION


NUHART EAST

UST LOCATION

- NOTES**
1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.

2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING

3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

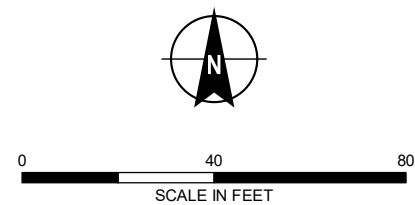

HALEY

ALDRICH

FORMER NUHART SITE

65, 75 DUPONT STREET

BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-04-29

Personnel : S. Sotomayor, A. Stewart
Weather : 47-56°F, Rain
Humidity : 88%
Wind Direction : E to W

Particulate Background (mg/m³) : 0.005
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
09:30	0.009	0.005	0.008	0.009	0.0	0.0	0.0	0.0		
09:45	0.007	0.004	0.005	0.004	0.0	0.0	0.0	0.0		
10:00	0.005	0.004	0.005	0.003	0.0	0.0	0.0	0.0		
10:15	0.006	0.003	0.013	0.003	0.0	0.0	0.0	0.0		
10:30	0.006	0.003	0.024	0.003	0.1	0.0	0.0	0.0		
10:45	0.005	0.003	0.005	0.003	0.0	0.0	0.0	0.0		
11:00	0.005	0.003	0.006	0.003	0.0	0.0	0.0	0.0		
11:15	0.005	0.003	0.005	0.003	0.0	0.0	0.0	0.0		
11:30	0.005	0.003	0.008	0.004	0.0	0.0	0.0	0.0		
11:45	0.005	0.003	0.003	0.003	0.0	0.0	0.0	0.0		
12:00	0.005	0.002	0.003	0.003	0.0	0.0	0.0	0.0		
12:15	0.004	0.002	0.002	0.003	0.0	0.0	0.0	0.0		
12:30	0.003	0.002	0.003	0.003	0.0	0.0	0.0	0.0		
12:45	0.003	0.002	0.002	0.003	0.0	0.0	0.0	0.0		
13:00	0.003	0.002	0.002	0.004	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.003	0.002	0.002	0.004	0.0	0.0	0.0	0.0		
13:30	0.003	0.001	0.002	0.005	0.0	0.0	0.0	0.0		
13:45	0.003	0.001	0.002	0.006	0.0	0.0	0.0	0.0		
14:00	0.003	0.001	0.002	0.007	0.0	0.0	0.0	0.0		
14:15	0.003	0.001	0.002	0.007	0.0	0.0	0.0	0.0		
14:30	0.003	0.001	0.002	0.007	0.0	0.0	0.0	0.0		
14:45	0.003	0.001	0.002	0.006	0.0	0.0	0.0	0.0		
15:00	0.003	0.001	0.002	0.008	0.0	0.0	0.0	0.0		
15:15	0.003	0.001	0.002	0.010	0.0	0.0	0.0	0.0		
15:30	0.003		0.003	0.011	0.0		0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	181
NYSDEC Site	NYSDEC Site 224136	Date	4/28/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	53-59°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc.	Wind Direction	From NE to SW up to 7 mph
Weather	Sunny	Personnel on Site	S. Sotomayor, A. Stewart
Humidity	70%	Time on Site	7:00am to 5:30pm

Haley & Aldrich of New York (Haley & Aldrich) was present to observe construction activities at the Site. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street.
- Contractor drilling through obstructions and installing sheet piles along southwest corner of the site.
- Contractor pre-drilling for sheet pile installation along Dupont Street.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	<i>Clean Earth of Carteret, NJ</i>												<i>Totals:</i>	
<i>Today:</i>	Loads 0	Tons 0											Loads 0	Tons 0
<i>Total:</i>	<u>15</u>	<u>180</u>											<u>15</u>	<u>180</u>

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:15 am to 5:15 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of sheet pile installation, facing west.

GIS: \\haleyaldrich.com\share\CP\Projects\2021\891\GIS\Maps\2023_04_Fomer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM




LEGEND

PROPOSED ENDPOINT SAMPLE
 SITE BOUNDARY
 TAX LOT BOUNDARY
 NUHART EAST

NUHART WEST
 APPROXIMATE WORK AREA
 CAMP STATION
 UST LOCATION

- NOTES**
1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING
3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

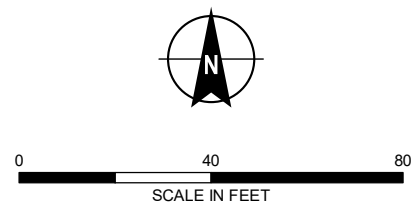

FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-05-01

Personnel : S. Sotomayor, A. Stewart
Weather : 53-59°F, Sunny
Humidity : 70%
Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.001
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.003	0.002	0.003		0.0	0.0	0.0			
07:15	0.002	0.001	0.004	0.001	0.0	0.0	0.0	0.0		
07:30	0.002	0.001	0.007	0.000	0.0	0.0	0.0	0.0		
07:45	0.002	0.000	0.004	0.001	0.0	0.0	0.0	0.0		
08:00	0.002	0.001	0.003	0.002	0.0	0.0	0.0	0.0		
08:15	0.003	0.001	0.004	0.002	0.0	0.0	0.0	0.0		
08:30	0.004	0.001	0.003	0.001	0.0	0.0	0.0	0.0		
08:45	0.003	0.001	0.003	0.001	0.0	0.0	0.0	0.0		
09:00	0.003	0.001	0.005	0.001	0.0	0.0	0.0	0.0		
09:15	0.004	0.001	0.003	0.001	0.0	0.0	0.0	0.0		
09:30	0.004	0.006	0.003	0.001	0.0	0.0	0.0	0.0		
09:45	0.004	0.005	0.003	0.001	0.0	0.0	0.0	0.0		
10:00	0.004	0.012	0.002	0.001	0.0	0.0	0.0	0.0		
10:15	0.004	0.002	0.002	0.004	0.0	0.0	0.0	0.1		
10:30	0.003	0.001	0.002	0.001	0.0	0.0	0.0	0.0		
10:45	0.003	0.002	0.003	0.000	0.0	0.0	0.0	0.0		
11:00	0.005	0.012	0.002	0.001	0.0	0.0	0.0	0.0		
11:15	0.004	0.001	0.002	0.002	0.0	0.0	0.0	0.0		
11:30	0.005	0.002	0.002	0.002	0.0	0.0	0.0	0.0		
11:45	0.010	0.005	0.002	0.001	0.0	0.0	0.0	0.0		
12:00	0.005	0.028	0.004	0.002	0.0	0.0	0.0	0.0		
12:15	0.004	0.023	0.006	0.002	0.0	0.0	0.0	0.0		
12:30	0.003	0.032	0.003	0.001	0.0	0.0	0.0	0.0		
12:45	0.004	0.005	0.003	0.001	0.0	0.0	0.0	0.0		
13:00	0.003	0.015	0.003	0.001	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.004	0.008	0.003	0.001	0.0	0.0	0.0	0.0		
13:30	0.003	0.011	0.005	0.002	0.0	0.0	0.0	0.0		
13:45	0.003	0.019	0.006	0.003	0.0	0.0	0.0	0.0		
14:00	0.004	0.011	0.004	0.002	0.0	0.0	0.0	0.0		
14:15	0.005	0.004	0.007	0.003	0.0	0.0	0.0	0.0		
14:30	0.006	0.011	0.004	0.007	0.0	0.0	0.0	0.0		
14:45	0.004	0.001	0.002	0.005	0.0	0.0	0.0	0.0		
15:00	0.004	0.000	0.003	0.003	0.0	0.0	0.0	0.0		
15:15	0.004	0.000	0.002	0.007	0.0	0.0	0.0	0.0		
15:30	0.004	0.001	0.003	0.006	0.0	0.0	0.0	0.0		
15:45	0.004	0.001	0.006	0.003	0.0	0.0	0.0	0.0		
16:00	0.004	0.001	0.004	0.003	0.0	0.0	0.0	0.0		
16:15	0.003	0.000	0.004	0.002	0.0	0.0	0.0	0.0		
16:30	0.003	0.001	0.005	0.002	0.0	0.0	0.0	0.0		
16:45	0.003	0.002	0.006	0.002	0.0	0.0	0.0	0.0		
17:00	0.003	0.002	0.007	0.003	0.0	0.0	0.0	0.0		
17:15	0.004	0.001	0.005	0.001	0.0	0.0	0.0	0.0		
17:30	0.004	0.001			0.0	0.0				

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	182
NYSDEC Site	NYSDEC Site 224136	Date	5/2/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	53-60°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc.	Wind Direction	From NE to SW up to 7 mph
Weather	Rainy	Personnel on Site	S. Sotomayor, A. Stewart
Humidity	54%	Time on Site	7:00am to 6:00pm

Haley & Aldrich of New York (Haley & Aldrich) was present to observe construction activities at the Site. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street.
- Contractor drilling through obstructions and installing sheet piles along northwest portion of the Site.
- Contractor installing sheet piles along Dupont Street.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	<i>Clean Earth of Carteret, NJ</i>												<i>Totals:</i>	
<i>Today:</i>	Loads 0	Tons 0											Loads 0	Tons 0
<i>Total:</i>	<u>15</u>	<u>180</u>											<u>15</u>	<u>180</u>

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:15 am to 5:45 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.


Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of sheet pile installation, facing west.

G:\S:\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Fomer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM

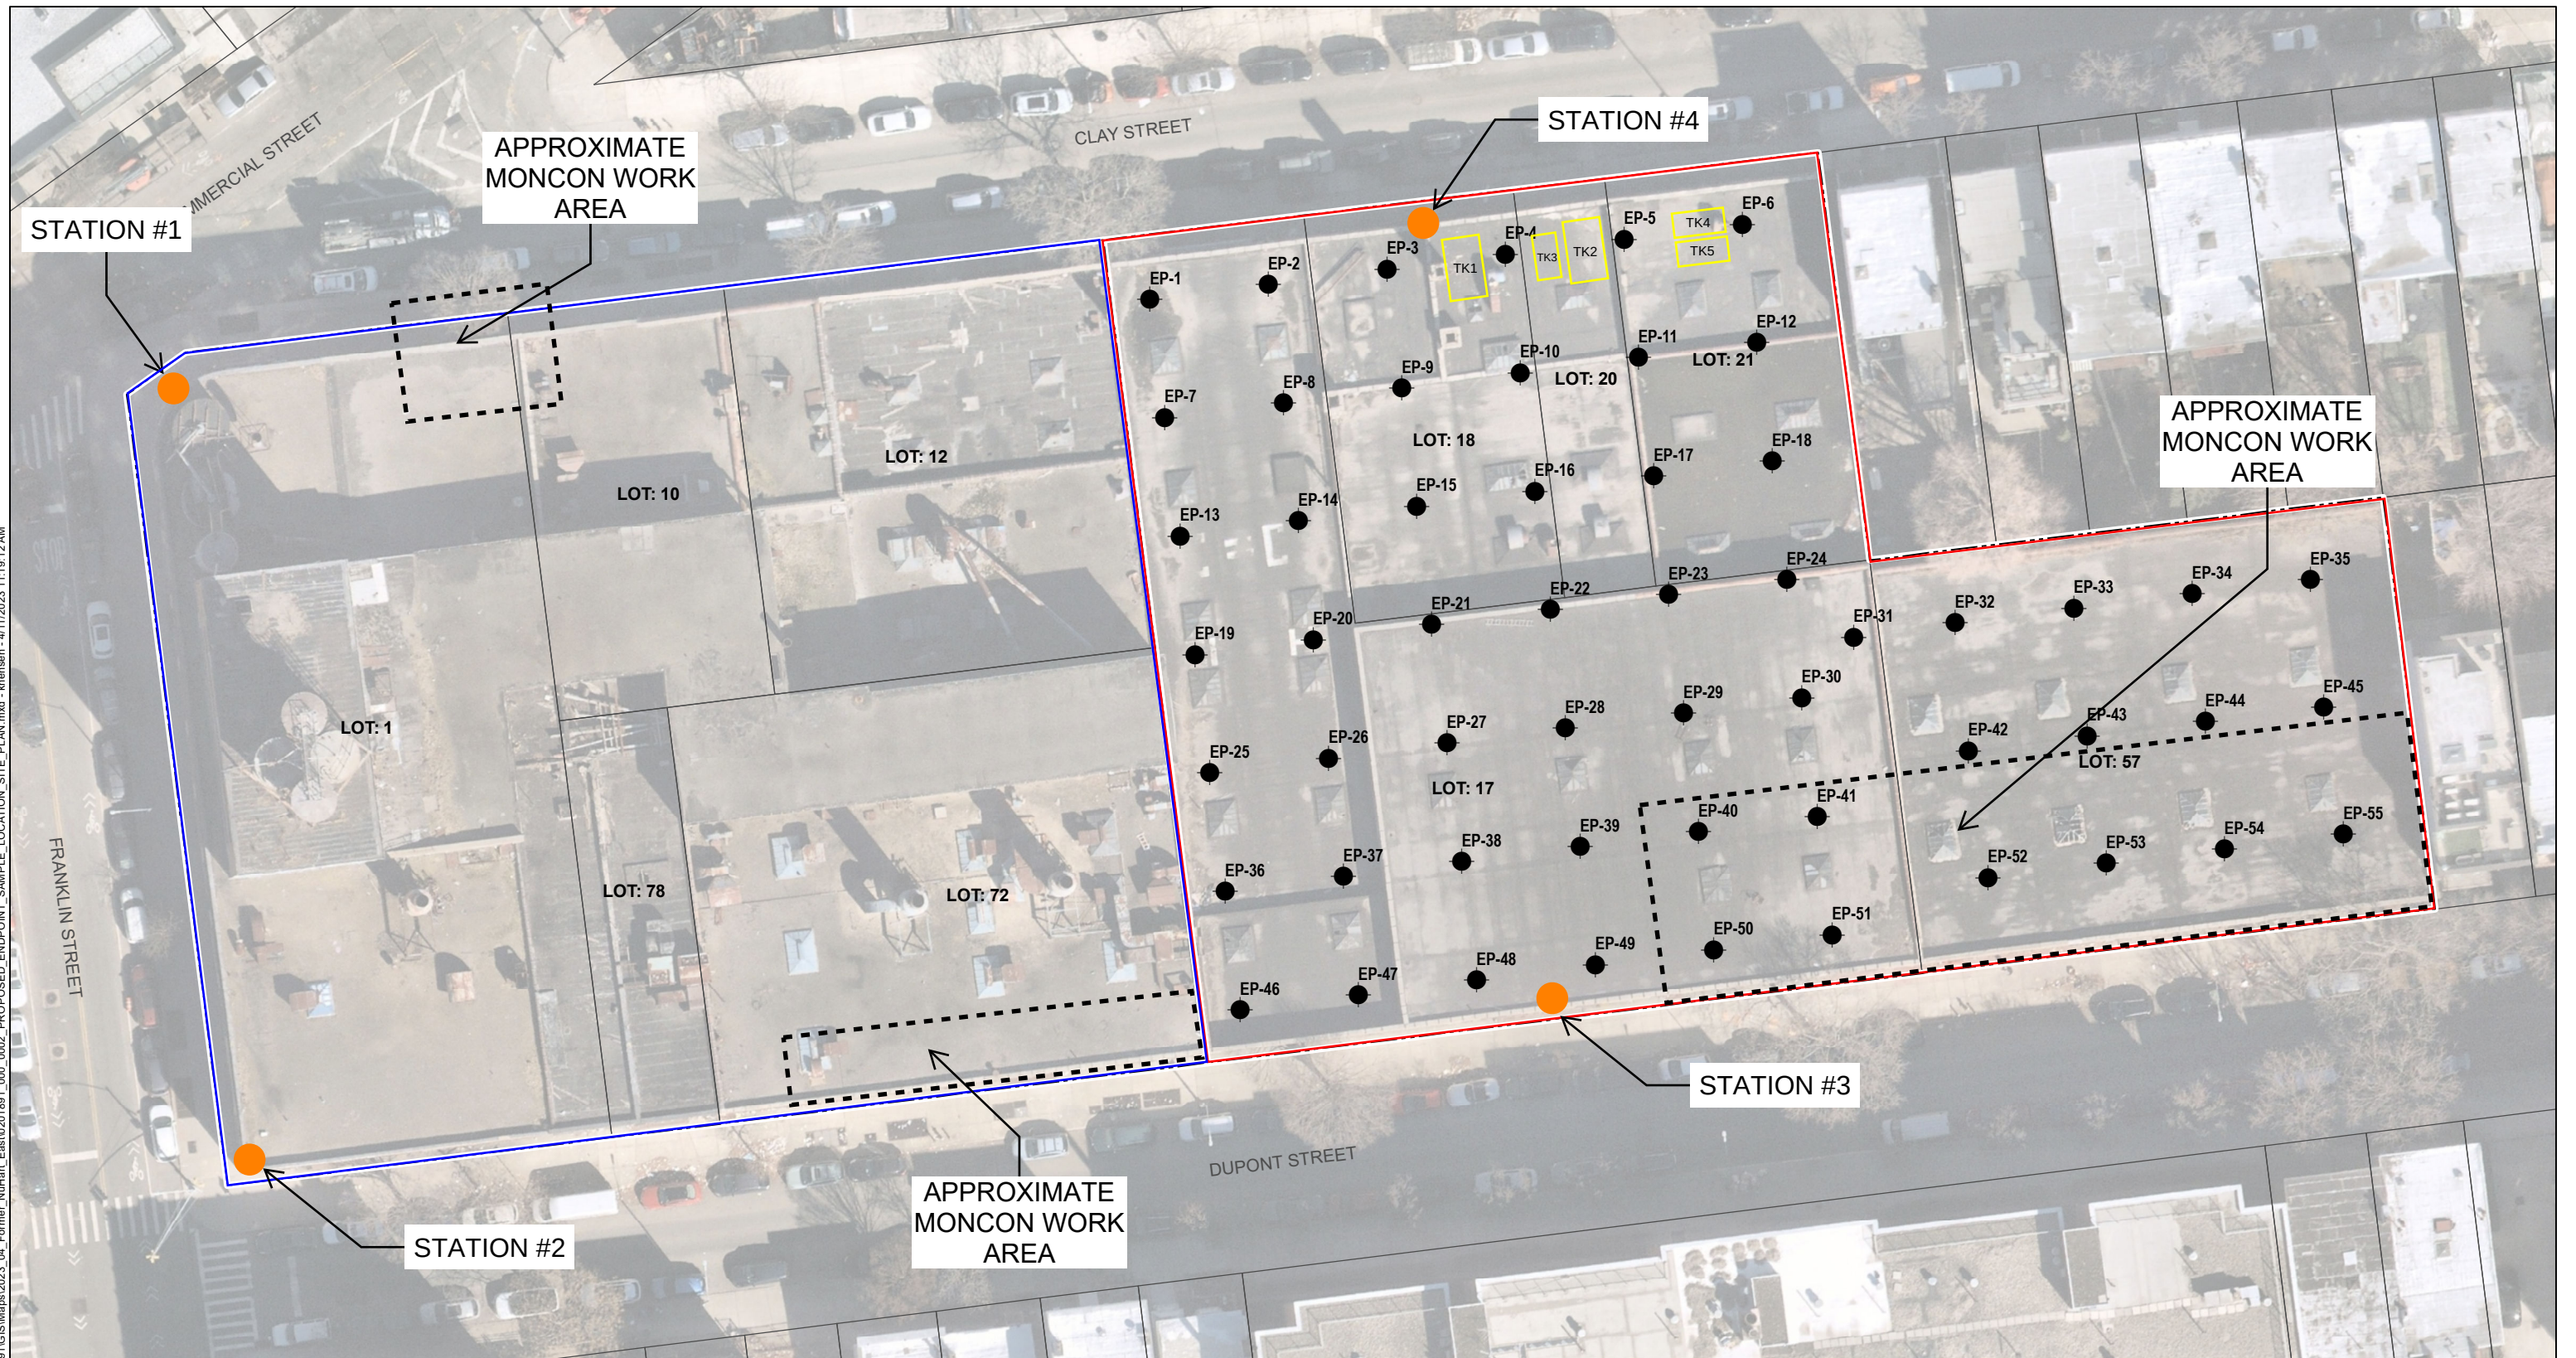

PROPOSED ENDPOINT SAMPLE

SITE BOUNDARY

TAX LOT BOUNDARY

NUHART EAST

NUHART WEST

APPROXIMATE WORK AREA

CAMP STATION

UST LOCATION

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING
3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

HALEY ALDRICH FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

APRIL 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-05-02

Personnel : S. Sotomayor, A. Stewart
Weather : 53-60°F, Cloudy/Rain
Humidity : 54%
Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.001
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.005			0.000	0.0			0.0		
07:15	0.001	0.002	0.009	0.001	0.0	0.0	0.0	0.0		
07:30	0.001	0.001	0.009	0.002	0.0	0.0	0.0	0.0		
07:45	0.001	0.000	0.028	0.002	0.0	0.0	0.0	0.0		
08:00	0.001	0.001	0.005	0.003	0.0	0.0	0.0	0.0		
08:15	0.002	0.001	0.006	0.005	0.0	0.0	0.0	0.0		
08:30	0.002	0.001	0.047	0.009	0.0	0.0	0.0	0.0		
08:45	0.002	0.001	0.014	0.007	0.0	0.0	0.0	0.0		
09:00	0.002	0.001	0.012	0.027	0.0	0.0	0.0	0.0		
09:15	0.003	0.001	0.012	0.008	0.0	0.0	0.0	0.0		
09:30	0.003	0.001	0.004	0.008	0.0	0.0	0.0	0.0		
09:45	0.003	0.001	0.003	0.007	0.5	0.0	0.0	0.0		
10:00	0.003	0.001	0.003	0.006	0.0	0.0	0.0	0.0		
10:15	0.002	0.000	0.003	0.007	0.0	0.0	0.0	0.0		
10:30	0.002	0.001	0.010	0.004	0.0	0.0	0.0	0.0		
10:45	0.003	0.001	0.006	0.004	0.0	0.0	0.0	0.0		
11:00	0.003	0.001	0.010	0.003	0.1	0.0	0.0	0.0		
11:15	0.003	0.001	0.008	0.003	0.0	0.0	0.0	0.0		
11:30	0.003	0.002	0.009	0.003	0.0	0.0	0.0	0.0		
11:45	0.003	0.000	0.005	0.003	0.0	0.0	0.0	0.1		
12:00	0.002	0.000	0.009	0.002	0.0	0.0	0.2	0.1		
12:15	0.003	0.000	0.002	0.003	0.0	0.0	0.1	0.1		
12:30	0.003	0.000	0.001	0.002	0.0	0.0	0.1	0.1		
12:45	0.002	0.000	0.002	0.002	0.0	0.0	0.0	0.1		
13:00	0.003	0.000	0.002	0.001	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.003	0.000	0.002	0.005	0.0	0.0	0.0	0.1		
13:30	0.002	0.000	0.003	0.004	0.0	0.0	0.0	0.1		
13:45	0.002	0.000	0.005	0.004	0.0	0.0	0.0	0.1		
14:00	0.009	0.048	0.003	0.005	0.0	0.0	0.0	0.1		
14:15	0.005	0.085	0.003	0.007	0.0	0.0	0.0	0.1		
14:30	0.005	0.008	0.002	0.007	0.0	0.0	0.0	0.1		
14:45	0.003	0.001	0.005	0.011	0.0	0.0	0.0	0.1		
15:00	0.008	0.001	0.007	0.010	0.0	0.0	0.0	0.1		
15:15	0.005	0.001	0.007	0.008	0.0	0.0	0.0	0.1		
15:30	0.003	0.001	0.004	0.007	0.0	0.0	0.0	0.0		
15:45	0.003	0.001	0.004	0.004	0.0	0.0	0.0	0.0		
16:00	0.004	0.001	0.004	0.008	0.0	0.0	0.0	0.1		
16:15	0.003	0.001	0.004	0.007	0.0	0.0	0.0	0.0		
16:30	0.004	0.001	0.002	0.005	0.0	0.0	0.0	0.0		
16:45	0.010	0.001	0.002	0.005	0.0	0.0	0.0	0.0		
17:00	0.009	0.001	0.002	0.004	0.0	0.0	0.0	0.0		
17:15	0.006	0.001	0.009	0.003	0.0	0.0	0.0	0.0		
17:30	0.007	0.001	0.003	0.002	0.0	0.0	0.0	0.0		
17:45	0.006	0.001	0.003	0.004	0.0	0.0	0.0	0.0		
18:00	0.005	0.001		0.004	0.0	0.0		0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	183
NYSDEC Site	NYSDEC Site 224136	Date	5/3/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	54-58°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc.	Wind Direction	From W to E up to 5 mph
Weather	Cloudy/Rain	Personnel on Site	S. Sotomayor, A. Stewart
Humidity	74%	Time on Site	7:00am to 6:00pm

Haley & Aldrich of New York (Haley & Aldrich) was present to observe construction activities at the Site. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street.
- Contractor installing sheet piles along Dupont Street.
- Construction meeting held with NYSDEC and all Site subcontractors.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	<i>Clean Earth of Carteret, NJ</i>												<i>Totals:</i>	
<i>Today:</i>	Loads 0	Tons 0											Loads 0	Tons 0
<i>Total:</i>	<u>15</u>	<u>180</u>											<u>15</u>	<u>180</u>

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:00 am to 5:45 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.


Activities Planned for Coming Week:

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of sheet pile installation, facing southeast.

GIS: \\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM

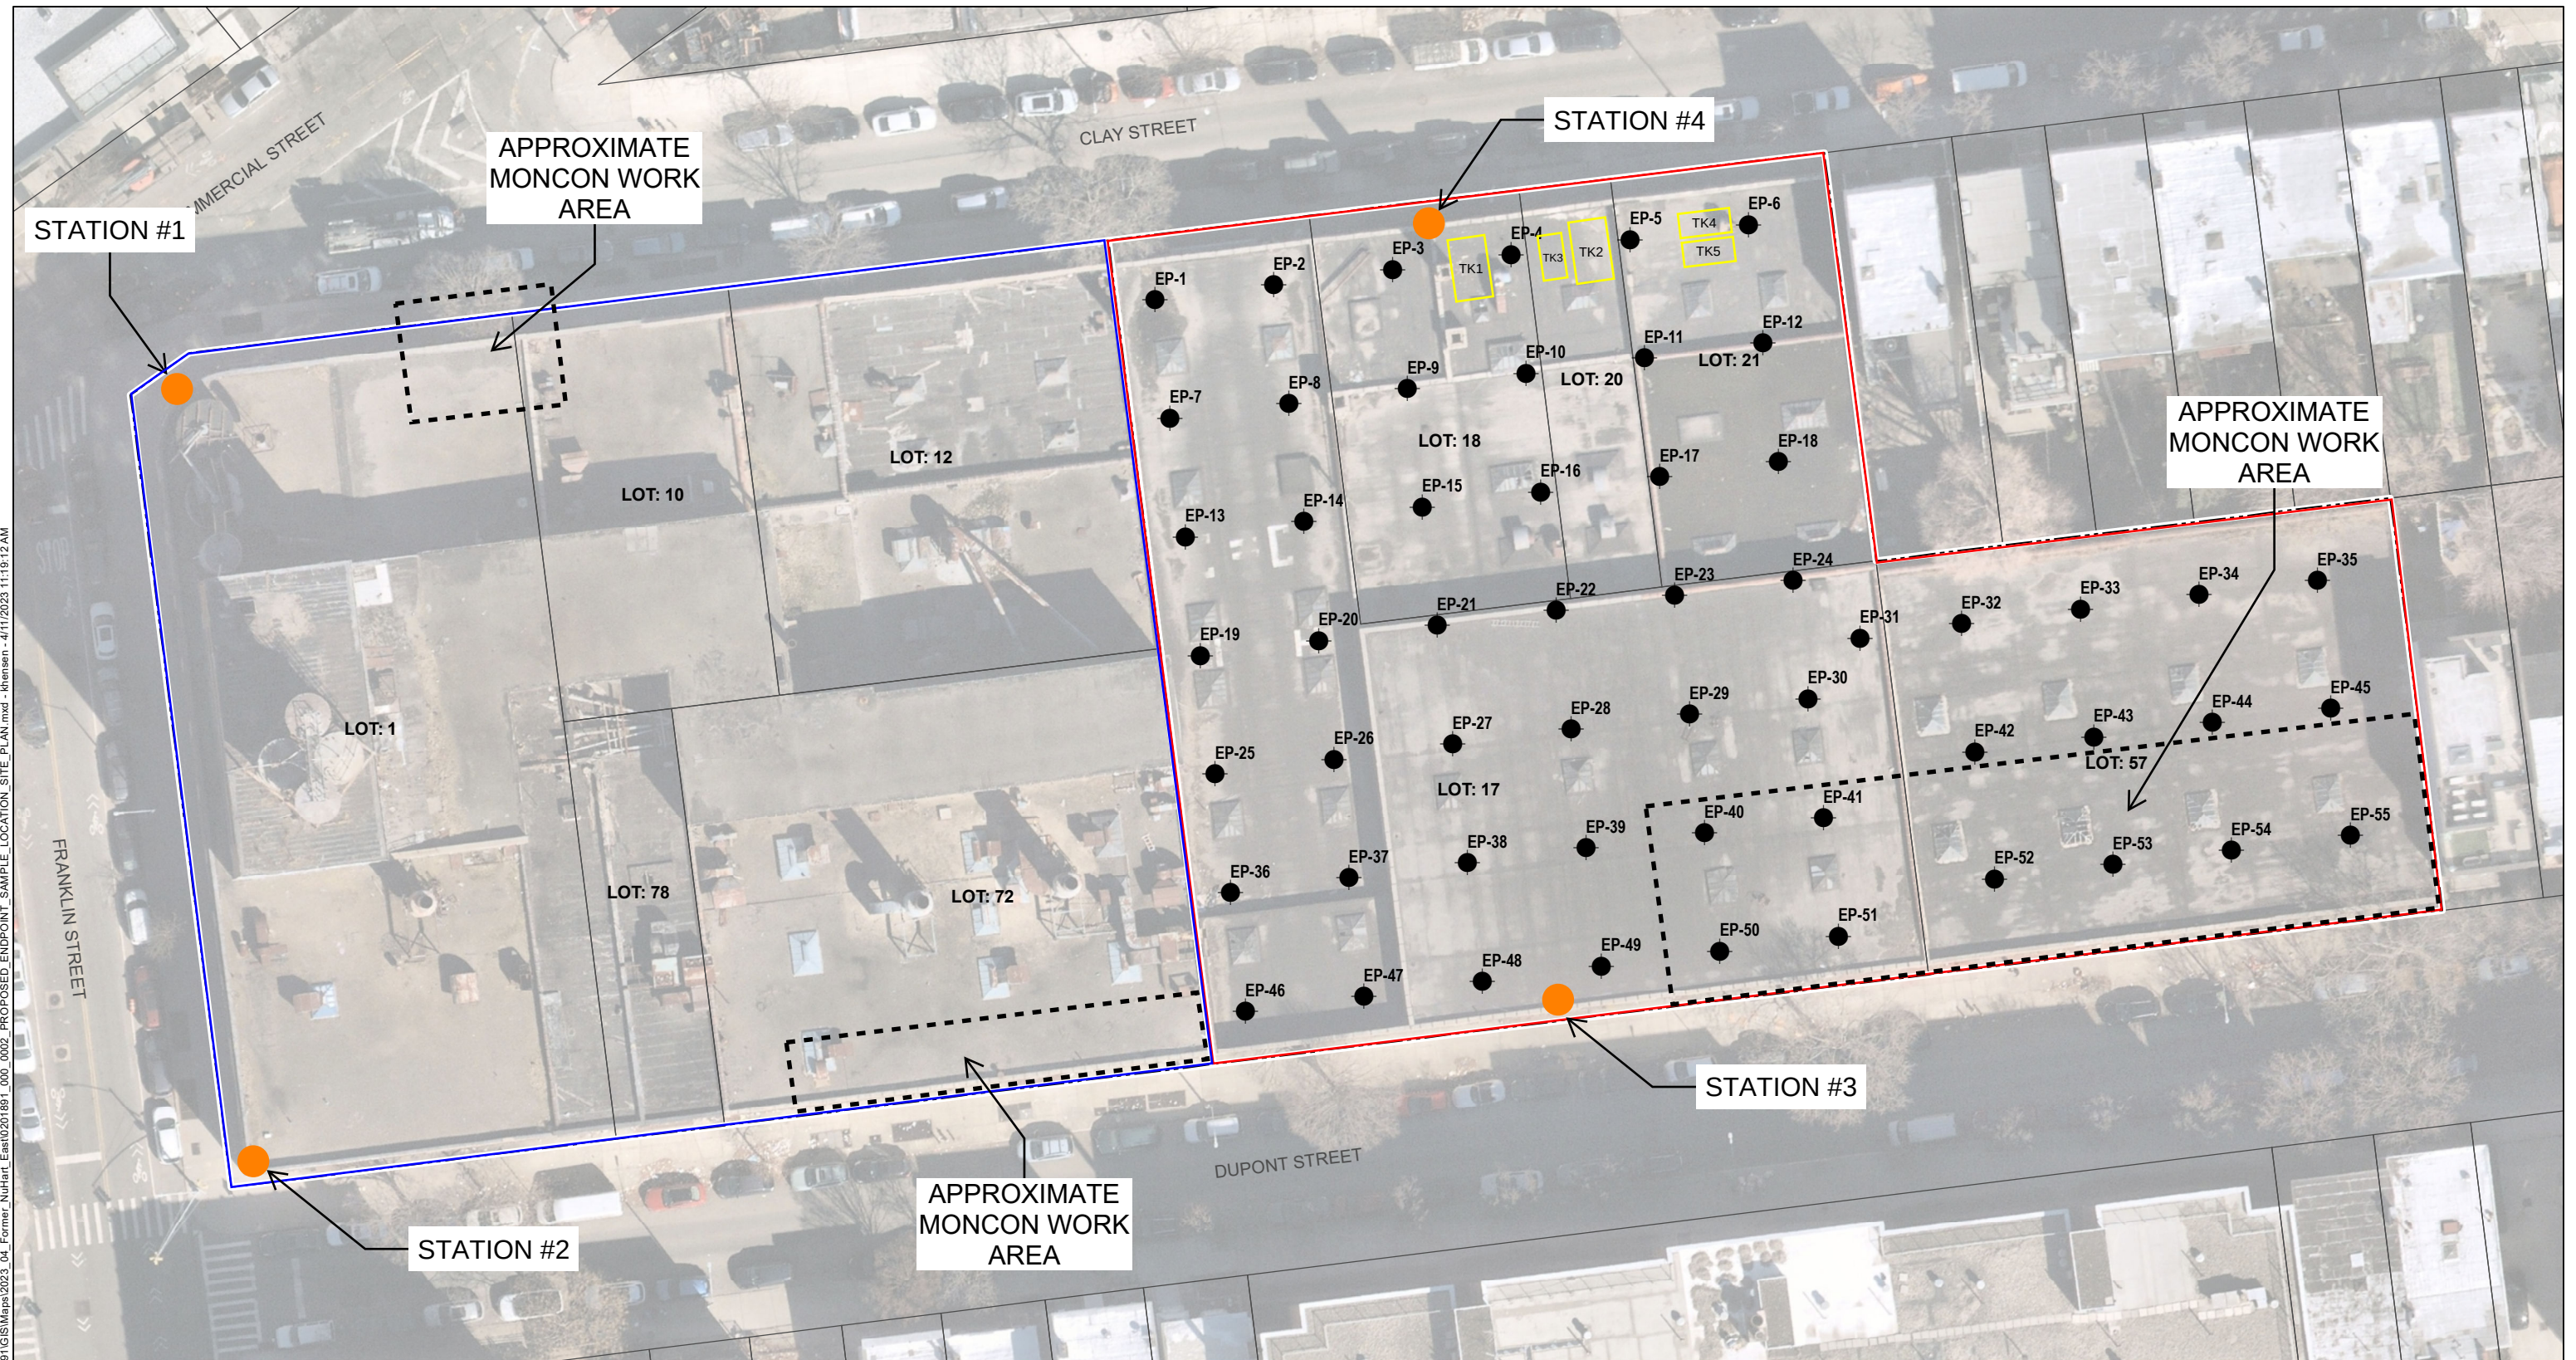

LEGEND

- | | |
|----------------------------|-------------------------|
| ● PROPOSED ENDPOINT SAMPLE | ▭ NUHART WEST |
| ▭ SITE BOUNDARY | ▭ APPROXIMATE WORK AREA |
| ▭ TAX LOT BOUNDARY | ● CAMP STATION |
| ▭ NUHART EAST | ▭ UST LOCATION |

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.
2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING
3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021



0 40 80
SCALE IN FEET

**HALEY
ALDRICH**

FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

MAY 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-05-03

Personnel : S. Sotomayor, A. Stewart
Weather : 54-58°F, Cloudy/Rain
Humidity : 74%
Wind Direction : W to E

Particulate Background (mg/m³) : 0.005
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.005	0.011	0.007	0.002	0.0	0.0	0.0	0.0		
07:15	0.004	0.002	0.005	0.004	0.0	0.0	0.0	0.0		
07:30	0.004	0.002	0.005	0.005	0.0	0.0	0.0	0.0		
07:45	0.004	0.001	0.004	0.003	0.0	0.0	0.0	0.0		
08:00	0.004	0.002	0.004	0.002	0.0	0.0	0.0	0.0		
08:15	0.005	0.001	0.005	0.003	0.0	0.0	0.0	0.0		
08:30	0.003	0.001	0.004	0.003	0.0	0.0	0.0	0.0		
08:45	0.011	0.002	0.003	0.002	0.1	0.0	0.0	0.0		
09:00	0.010	0.002	0.006	0.002	0.1	0.0	0.0	0.0		
09:15	0.005	0.002	0.011	0.004	0.0	0.0	0.0	0.0		
09:30	0.004	0.002	0.006	0.003	0.0	0.0	0.0	0.0		
09:45	0.004	0.003	0.004	0.004	0.0	0.0	0.0	0.0		
10:00	0.006	0.001	0.003	0.003	0.0	0.0	0.0	0.0		
10:15	0.003	0.001	0.004	0.005	0.0	0.0	0.0	0.0		
10:30	0.002	0.001	0.003	0.002	0.0	0.0	0.0	0.0		
10:45	0.002	0.001	0.005	0.003	0.0	0.0	0.0	0.0		
11:00	0.002	0.001	0.005	0.002	0.0	0.0	0.0	0.0		
11:15	0.002	0.001	0.003	0.002	0.0	0.0	0.0	0.0		
11:30	0.002	0.001	0.003	0.001	0.1	0.0	0.0	0.0		
11:45	0.002	0.001	0.003	0.001	0.4	0.0	0.0	0.0		
12:00	0.001	0.001	0.002	0.001	0.1	0.0	0.0	0.0		
12:15	0.001	0.001	0.002	0.001	0.0	0.0	0.0	0.0		
12:30	0.002	0.001	0.002	0.001	0.0	0.0	0.0	0.0		
12:45	0.009	0.001	0.013	0.001	0.0	0.0	0.0	0.0		
13:00	0.012	0.001	0.003	0.001	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.002	0.001	0.002	0.000	0.0	0.0	0.0	0.0		
13:30	0.005	0.001	0.007	0.001	0.0	0.0	0.0	0.0		
13:45	0.004	0.001	0.005	0.000	0.0	0.0	0.0	0.0		
14:00	0.002	0.000	0.002	0.000	0.0	0.0	0.0	0.0		
14:15	0.003	0.000	0.002	0.000	0.0	0.0	0.0	0.0		
14:30	0.003	0.000	0.004	0.000	0.0	0.0	0.0	0.0		
14:45	0.003	0.001	0.010	0.002	0.0	0.0	0.0	0.0		
15:00	0.002	0.000	0.005	0.001	0.0	0.0	0.0	0.0		
15:15	0.002	0.001	0.004	0.001	0.0	0.0	0.0	0.0		
15:30	0.012	0.000	0.033	0.000	0.0	0.0	0.0	0.0		
15:45	0.003	0.000	0.003	0.000	0.0	0.0	0.0	0.0		
16:00	0.002	0.000	0.002	0.000	0.0	0.0	0.0	0.0		
16:15	0.002	0.000	0.002	0.000	0.0	0.0	0.0	0.0		
16:30	0.002	0.000	0.007	0.001	0.0	0.0	0.0	0.0		
16:45	0.002	0.000	0.003	0.001	0.0	0.0	0.0	0.0		
17:00	0.002	0.000	0.003	0.002	0.0	0.0	0.0	0.0		
17:15	0.002	0.001	0.012	0.002	0.0	0.0	0.0	0.0		
17:30	0.002	0.001	0.005	0.002	0.0	0.0	0.0	0.0		
17:45	0.003	0.001	0.002	0.002	0.0	0.0	0.0	0.0		



Haley & Aldrich of New York (Haley & Aldrich) was present to observe construction activities at the Site. Site Observations are summarized below.

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street.
- Contractor installing sheet piles along Dupont Street.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

- Soil/Fill disposal is summarized below:

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

- None

- None


Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:30 am to 5:15 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.

- Continue installation of sheet pile walls and clearing obstructions.

Site Photographs:

Photo 1: View of sheet pile installation, facing southwest.

G:\S:\haleyaldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM

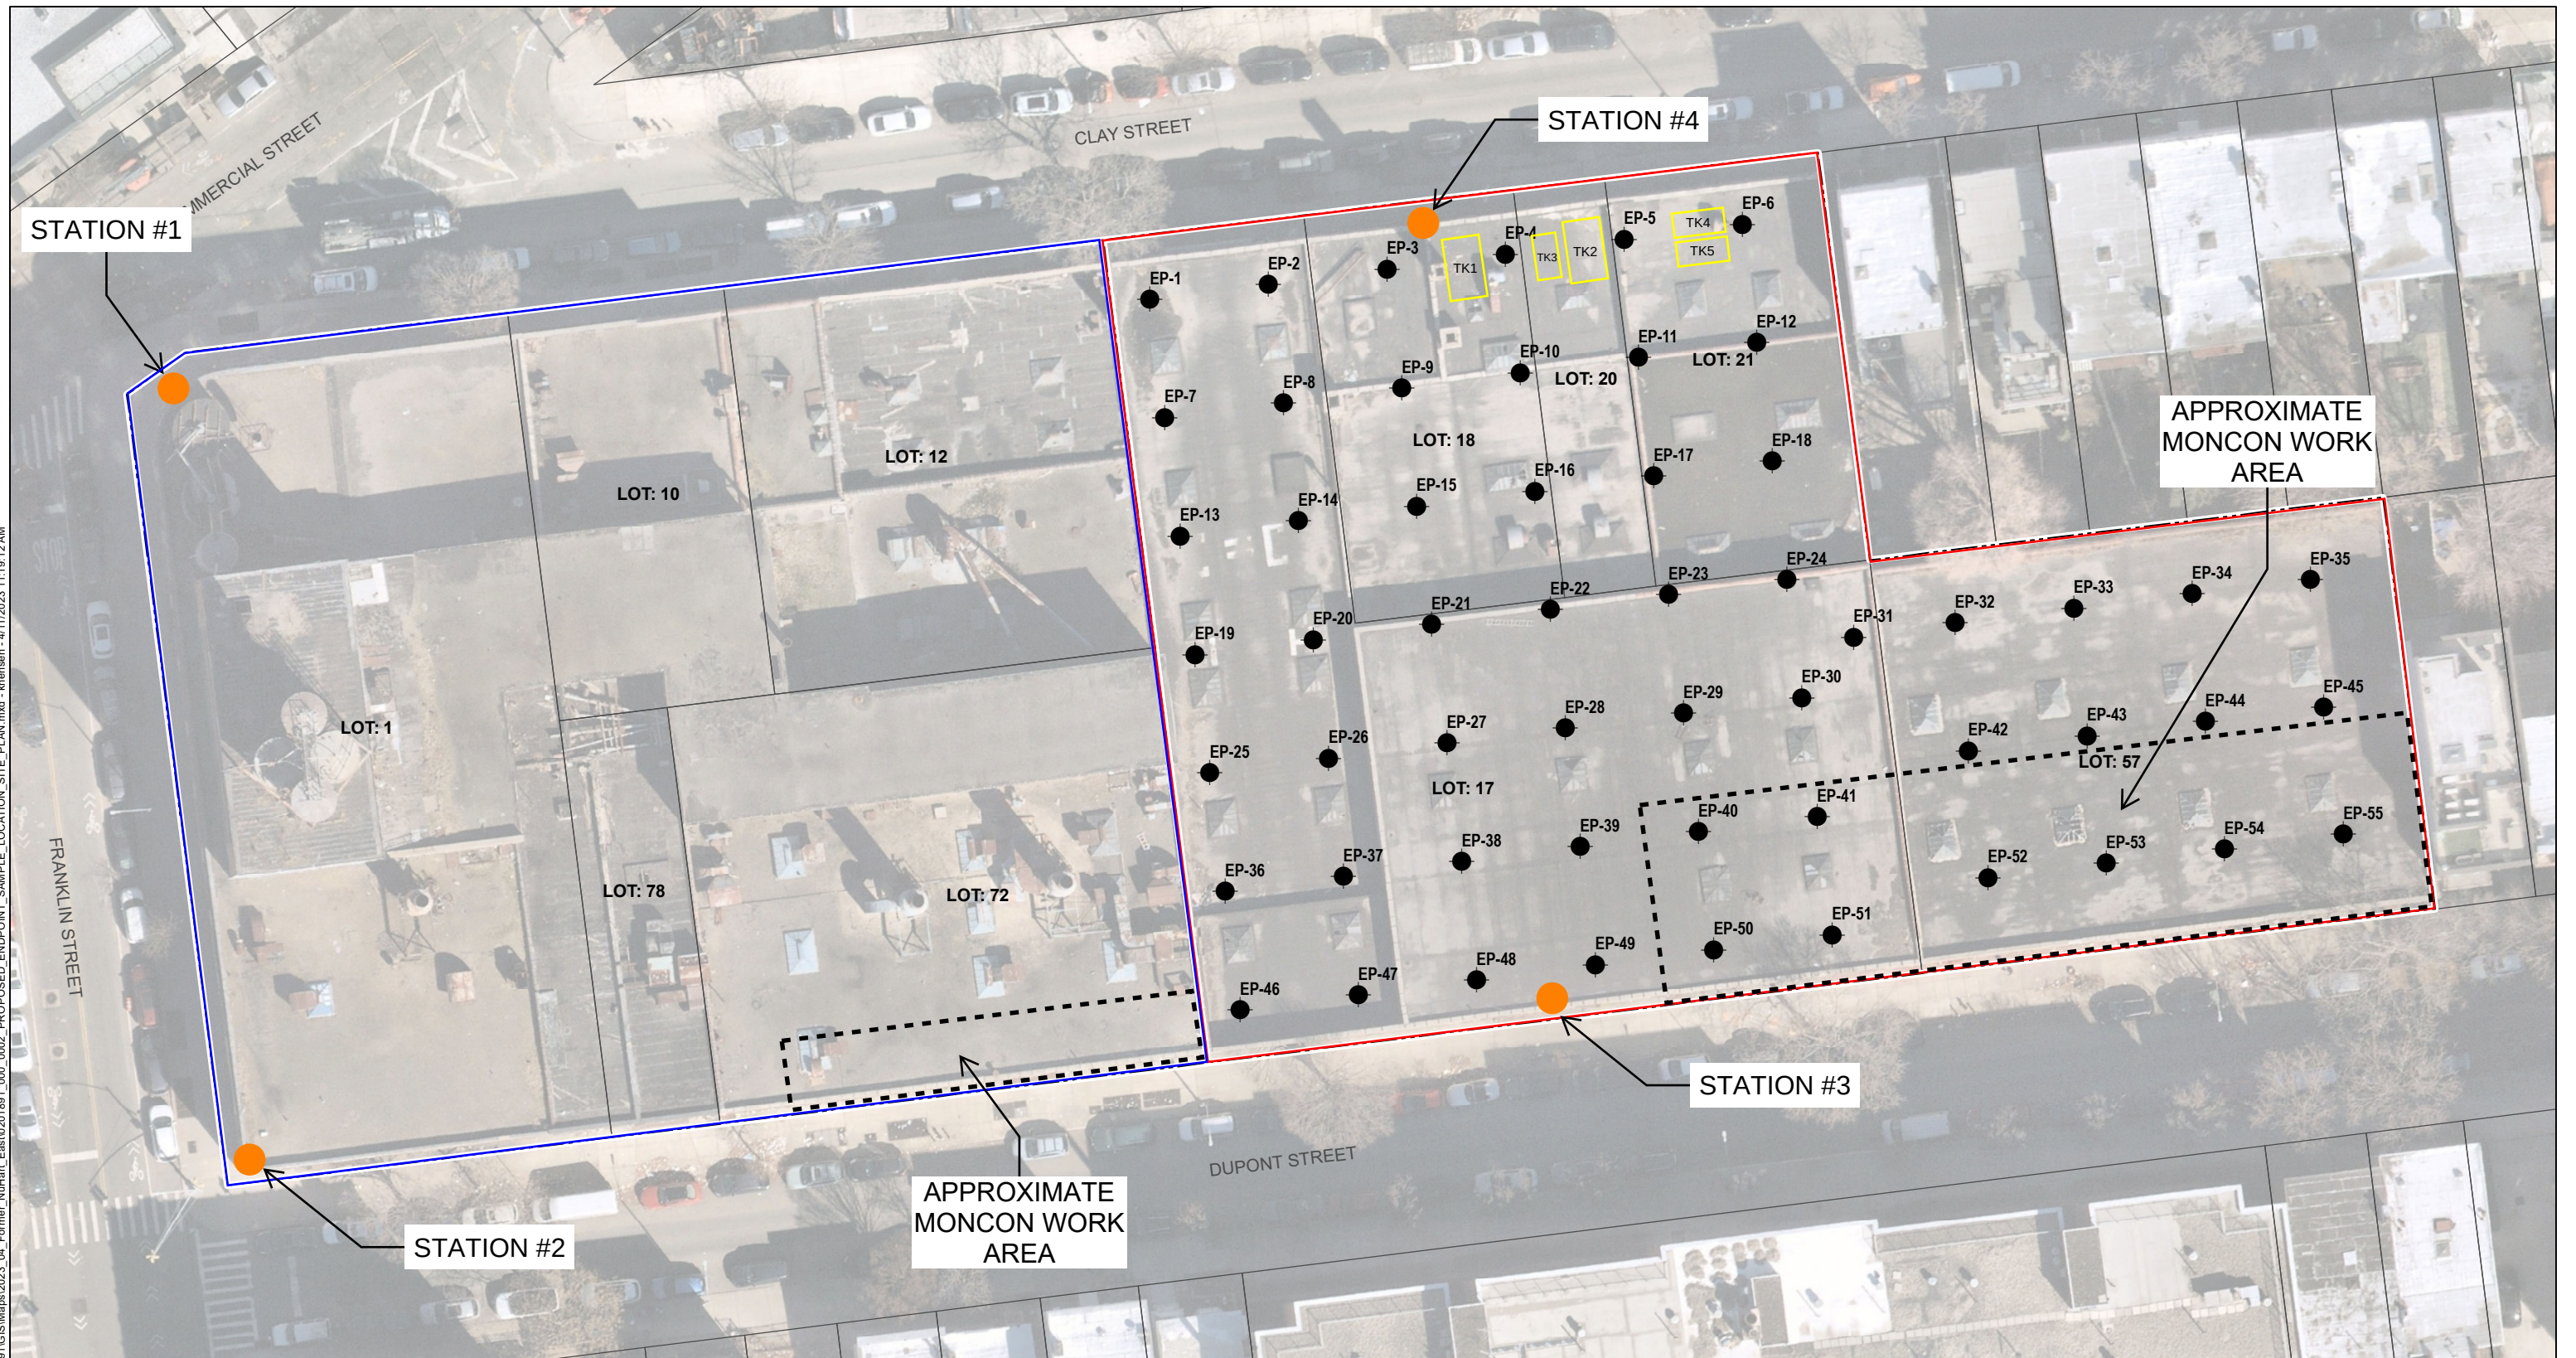

LEGEND

PROPOSED ENDPOINT SAMPLE

SITE BOUNDARY

TAX LOT BOUNDARY

NUHART EAST

NUHART WEST

APPROXIMATE WORK AREA

CAMP STATION

UST LOCATION

NOTES

1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.

2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING

3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

N

0

40

80

SCALE IN FEET

H

ALEY

A

LD

R

I

C

H

FORMER NUHART SITE

65, 75 DUPONT STREET

BROOKLYN, NY

SITE MAP

MAY 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-05-04

Personnel : S. Sotomayor, A. Stewart
Weather : 51-58°F, Sunny
Humidity : 78%
Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.004
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:00	0.005		0.005	0.004	0.0		0.0	0.0		
07:15	0.005		0.003	0.003	0.0		0.0	0.0		
07:30	0.005	0.009	0.005	0.004	0.0	0.0	0.0	0.0		
07:45	0.005	0.003	0.007	0.005	0.0	0.0	0.0	0.0		
08:00	0.003	0.002	0.005	0.004	0.0	0.0	0.0	0.0		
08:15	0.003	0.002	0.007	0.004	0.0	0.0	0.0	0.0		
08:30	0.004	0.002	0.005	0.004	0.0	0.0	0.0	0.0		
08:45	0.005	0.002	0.005	0.004	0.0	0.0	0.0	0.0		
09:00	0.004	0.002	0.005	0.004	0.0	0.0	0.0	0.0		
09:15	0.003	0.001	0.004	0.004	0.0	0.0	0.0	0.0		
09:30	0.004	0.002	0.007	0.004	0.0	0.0	0.0	0.0		
09:45	0.004	0.002	0.005	0.004	0.0	0.0	0.0	0.0		
10:00	0.004	0.001	0.005	0.003	0.0	0.0	0.0	0.0		
10:15	0.004	0.001	0.003	0.004	0.0	0.0	0.0	0.0		
10:30	0.004	0.001	0.003	0.003	0.0	0.0	0.0	0.0		
10:45	0.004	0.001	0.003	0.004	0.0	0.0	0.0	0.0		
11:00	0.003	0.001	0.005	0.002	0.0	0.0	0.0	0.0		
11:15	0.004	0.002	0.004	0.003	0.0	0.0	0.1	0.0		
11:30	0.003	0.016	0.005	0.003	0.0	0.0	0.1	0.0		
11:45	0.003	0.005	0.005	0.003	0.0	0.1	0.1	0.0		
12:00	0.004	0.003	0.008	0.003	0.0	0.0	0.1	0.0		
12:15	0.005	0.002	0.007	0.002	0.0	0.0	0.0	0.0		
12:30	0.003	0.002	0.004	0.003	0.0	0.0	0.0	0.0		
12:45	0.003	0.001	0.003	0.003	0.0	0.0	0.0	0.0		
13:00	0.003	0.001	0.003	0.003	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.003	0.002	0.004	0.003	0.0	0.0	0.0	0.0		
13:30	0.004	0.002	0.005	0.003	0.4	0.0	0.0	0.0		
13:45	0.005	0.002	0.005	0.004	0.1	0.0	0.0	0.0		
14:00	0.004	0.001	0.006	0.003	0.0	0.0	0.1	0.0		
14:15	0.004	0.001	0.004	0.003	0.0	0.0	0.0	0.0		
14:30	0.004	0.001	0.006	0.003	0.0	0.0	0.0	0.0		
14:45	0.003	0.002	0.016	0.003	0.0	0.0	0.0	0.0		
15:00	0.005	0.002	0.022	0.004	0.0	0.0	0.0	0.0		
15:15	0.006	0.002	0.017	0.003	0.0	0.0	0.0	0.0		
15:30	0.004	0.016	0.025	0.003	0.0	0.0	0.0	0.0		
15:45	0.005	0.005	0.009	0.004	0.0	0.0	0.0	0.0		
16:00	0.005	0.002	0.009	0.004	0.0	0.0	0.0	0.0		
16:15	0.004	0.002	0.004	0.004	0.0	0.0	0.0	0.0		
16:30	0.005	0.003	0.005	0.004	0.0	0.0	0.0	0.0		
16:45	0.006	0.002	0.005	0.004	0.0	0.0	0.0	0.0		
17:00	0.013	0.003	0.007	0.005	0.0	0.0	0.0	0.0		
17:15	0.007	0.003	0.009	0.005	0.0	0.0	0.0	0.0		

DAILY FIELD REPORT

Project	Former NuHart West Site	Report No.	185
NYSDEC Site	NYSDEC Site 224136	Date	5/5/2023
Location	49 Dupont Street, Brooklyn, NY	File No.	0203497-002
Client	Dupont Street Owner LLC	Temperature	53-60°F
Contractor	Haley & Aldrich, OmniBuild, Moncon Inc.	Wind Direction	From NE to SW up to 4 mph
Weather	Sunny	Personnel on Site	S. Sotomayor, M. Boland
Humidity	79%	Time on Site	7:00am to 4:45pm

Haley & Aldrich of New York (Haley & Aldrich) was present to observe construction activities at the Site. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich gauged accessible wells along Franklin & Dupont Street.
- Contractor installing sheet piles along Dupont Street.
- Contractor completes installing sheet piles for the OU-1 LNAPL barrier wall.
- Contractor demobilized equipment and secured the Site. Haley & Aldrich concluded remedial oversight activities and demobilized from the site.

Waste Disposal/Backfill Import Tracking:

Material Export:

- Soil/Fill disposal is summarized below:

	<i>Clean Earth of Carteret, NJ</i>												<i>Totals:</i>	
<i>Today:</i>	Loads 0	Tons 0											Loads 0	Tons 0
<i>Total:</i>	<u>15</u>	<u>180</u>											<u>15</u>	<u>180</u>

Notes:

Soil from OU-2 only.

Tonnage is approximate, final tonnages will be included in the Final Engineering Report

Material Import:

- None

Samples Collected:

- None

CAMP Activities:

Community air monitoring was performed at two upwind and two downwind locations during intrusive work activities on-Site from 7:30 am to 4:30 pm. No 15-minute average concentrations of particulates exceeded action levels at the CAMP stations. No visual dust was observed leaving the site.


Activities Planned for Coming Week:

- Housekeeping

Site Photographs:

Photo 1: View of sheet pile installation, facing southwest.

C:\GIS\HaleylAldrich.com\share\CP\Projects\0201891\GIS\Maps\2023_04_Farmer_Nuhart_East\0201891_000_0002_PROPOSED_ENDPOINT_SAMPLE_LOCATION_SITE_PLAN.mxd - khansen - 4/11/2023 11:19:12 AM

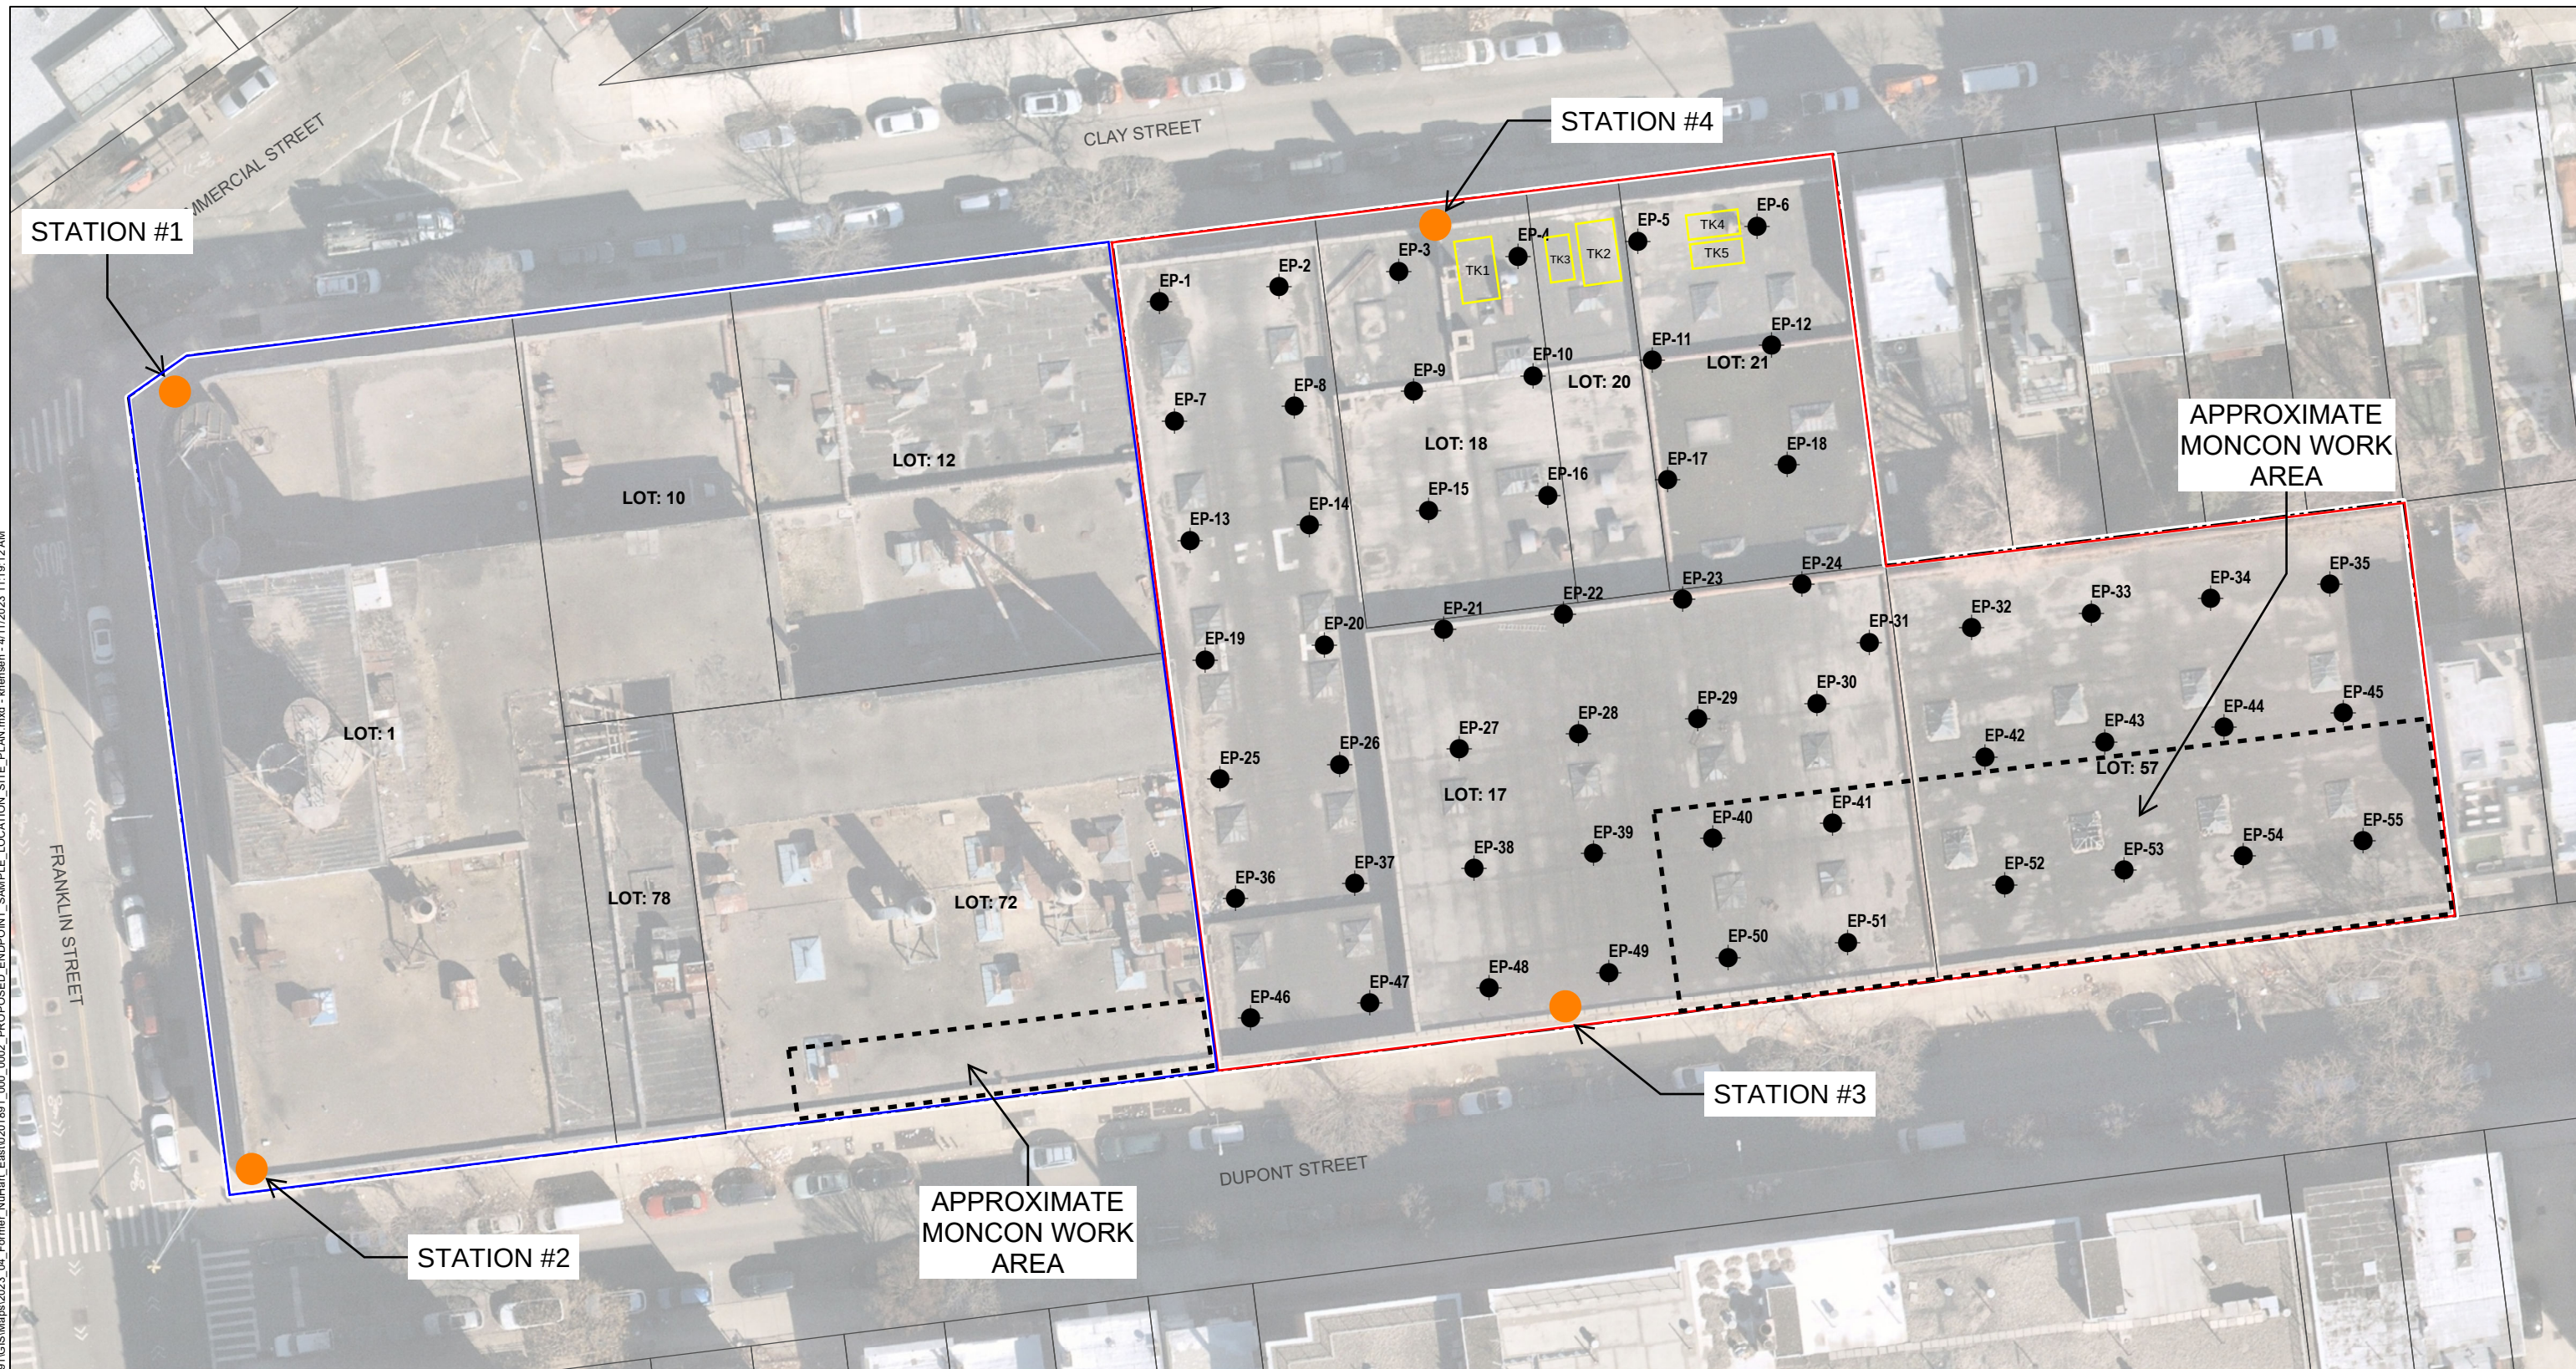

LEGEND

PROPOSED ENDPOINT SAMPLE

NUHART WEST

SITE BOUNDARY

TAX LOT BOUNDARY

NUHART EAST

CAMP STATION


UST LOCATION

APPROXIMATE WORK AREA

- NOTES**
1. ALL LOCATIONS AND DIMENSIONS ARE APPROXIMATE.

2. ASSESSOR PARCEL DATA SOURCE: NYC DEPARTMENT OF CITY PLANNING

3. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021

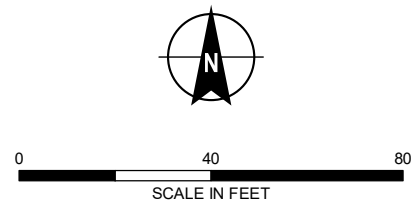

HALEY

ALDRICH

FORMER NUHART SITE
65, 75 DUPONT STREET
BROOKLYN, NY

SITE MAP

MAY 2023

FIGURE 1

Former NuHart West Site
0203497
Air Monitoring Log

Date : 2023-05-05

Personnel : S. Sotomayor, M. Boland
Weather : 53-60°F, Sunny
Humidity : 79%
Wind Direction : NE to SW

Particulate Background (mg/m³) : 0.002
PID Background (ppm) : 0.0

Action Levels : Downwind perimeter of work area above background levels

PID (ppm) : > 5 ppm for the 15-min average

Dust (mg/m³) : > 0.150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional M..
07:30	0.003	0.002	0.006	0.002	0.0	0.0	0.0	0.0		
07:45	0.002	0.002	0.009	0.002	0.0	0.0	0.0	0.0		
08:00	0.002	0.001	0.006	0.002	0.0	0.0	0.0	0.0		
08:15	0.003	0.002	0.007	0.003	0.0	0.0	0.0	0.0		
08:30	0.005	0.002	0.006	0.003	0.0	0.0	0.0	0.0		
08:45	0.003	0.002	0.006	0.003	0.0	0.0	0.0	0.0		
09:00	0.002	0.002	0.004	0.002	0.0	0.0	0.0	0.0		
09:15	0.002	0.001	0.005	0.001	0.0	0.0	0.0	0.0		
09:30	0.002	0.001	0.005	0.001	0.0	0.0	0.0	0.0		
09:45	0.002	0.001	0.005	0.001	0.0	0.0	0.0	0.0		
10:00	0.001	0.001	0.014	0.001	0.0	0.0	0.0	0.0		
10:15	0.002	0.002	0.026	0.001	0.0	0.0	0.0	0.0		
10:30	0.002	0.002	0.010	0.001	0.0	0.0	0.0	0.0		
10:45	0.002	0.001	0.013	0.001	0.0	0.0	0.0	0.0		
11:00	0.003	0.002	0.017	0.001	0.0	0.0	0.0	0.0		
11:15	0.002	0.001	0.017	0.001	0.0	0.0	0.0	0.0		
11:30	0.002	0.073	0.015	0.001	0.0	0.0	0.0	0.0		
11:45	0.002	0.002	0.006	0.001	0.0	0.0	0.0	0.0		
12:00	0.002	0.002	0.020	0.001	0.0	0.0	0.0	0.0		
12:15	0.003	0.003	0.008	0.001	0.0	0.0	0.0	0.0		
12:30	0.002	0.001	0.004	0.000	0.0	0.0	0.0	0.0		
12:45	0.001	0.001	0.001	0.000	0.0	0.0	0.0	0.0		
13:00	0.001	0.001	0.002	0.000	0.0	0.0	0.0	0.0		

Former NuHart West Site
0203497
Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
13:15	0.002	0.001	0.007	0.001	0.0	0.0	0.0	0.0		
13:30	0.002	0.001	0.004	0.001	0.0	0.0	0.0	0.0		
13:45	0.004	0.003	0.012	0.002	0.0	0.0	0.0	0.0		
14:00	0.006	0.005	0.022	0.004	0.0	0.0	0.0	0.0		
14:15	0.005	0.004	0.022	0.004	0.0	0.0	0.0	0.0		
14:30	0.006	0.004	0.022	0.003	0.0	0.0	0.0	0.0		
14:45	0.006	0.004	0.036	0.005	0.0	0.0	0.0	0.0		
15:00	0.005	0.003	0.025	0.006	0.0	0.0	0.0	0.0		
15:15	0.006	0.004	0.011	0.006	0.0	0.0	0.0	0.0		
15:30	0.006	0.021	0.011	0.006	0.0	0.0	0.0	0.0		
15:45	0.007	0.003	0.037	0.005	0.0	0.0	0.0	0.0		
16:00	0.005	0.002	0.023	0.004	0.0	0.0	0.0	0.0		
16:15	0.005	0.002	0.033	0.004	0.0	0.0	0.0	0.0		
16:30	0.005	0.001	0.011	0.005	0.0	0.0	0.0	0.0		