

Project	Former Port Mobil Terminal –	Report No.	30	
	IRM #1			
NYSDEC Site	#243016	Date	11/1/2024	
Location	4101 Arthur Kill Road	File No.	0208988	
	Staten Island, NY			
Client	NP Staten Island Industrial, LLC	Temperature	57-66°F	
Contractor	Entact, Haley & Aldrich	Wind Direction	W to E up to 9 mph	
Weather	Sunny	Personnel on Site	S. Sotomayor,	
			K. O'Connor	
Humidity	54%	Time on Site	6:30 am to 5:00 pm	

H&A of New York Engineering and Geology, LLP (Haley & Aldrich) was present to document the implementation of the August 2024 NYSDEC-approved Interim Remedial Measures 1 Work Plan (IRM 1 Work Plan) prepared by Haley & Aldrich for the Former Port Mobil Terminal, located at 4101 Arthur Kill Road, Staten Island, NY. Site Observations are summarized below.

Daily Observations:

- Haley & Aldrich field personnel performed community air monitoring during the implementation of the activities in the approved IRM 1 Work Plan.
- Entact loaded thirty-two (32) tri-axle trucks with soil from Excavation 9 for transport to Pure Soil Technologies in Jackson, NJ for off-site disposal.
- Entact continued excavation and stockpiling of soil in Excavation 9, stockpiled soil staged on tarp pad and covered at the end of the workday.
- Entact used absorbent socks to collect LNAPL in Excavation 5 and used Hydo-vac truck to extract LNAPL from the excavations.
- Entact completed LNAPL recovery in Excavation 1 and 5, reaching the final limits of excavation. Long-term odor suppressant foam was applied once excavations were deemed completed.
- Excavation 9 Background PID Reading: 0.0 ppm, Stockpile PID Reading: 102.4 ppm

Waste Disposal/Backfill Import Tracking:

Material Export:

• Soil/Fill disposal is summarized below:

Facility	Pure Soil Technologies Jackson, NJ						То	tal
Today:	Loads 32	Tons 640	Loads 0	Tons 0	Loads 0	Tons 0	Loads 32	Tons 640
<u>Total:</u>	<u>189</u>	<u>3,780</u>	<u>0</u>	<u>0</u>	<u>0</u>	<u>0</u>	<u>189</u>	<u>3,780</u>

Note: Tonnage is approximate, executed tonnages to be included in the Construction Completion Report.



Material Import:

• Fill import is summarized below:

Facility	Mount Ho ASTM #57		Total		
Today:	Loads 0	CY 0	Loads 0	CY 0	
<u>Total:</u> <u>53</u> <u>1</u>		1,334.48	<u>53</u>	1,334.48	

Note: 1 truckload estimated at 20 cubic yards. Quantities to be included in the Construction Completion Report.

Samples Collected:

None.

CAMP Activities:

- Background air monitoring was performed at three locations, one at the western boundary of the IRM 1 work area, one at the central location of the IRM 1 work area, and one at the eastern boundary of the IRM 1 work area, from 6:30 AM to 4:15 PM.
- No 15-minute average concentrations of VOCs or particulate matter smaller than 10 microns in diameter (PM10) exceeded the action levels. No visible dust was observed leaving the site perimeter.

Activities Planned for Coming Week:

- Entact will begin support of excavation (SOE) installation.
- Entact will continue excavating and stockpiling C&D debris for disposal.
- Entact will continue excavating soil for off-site transport and disposal.
- Confirmation endpoint sampling for completed excavations.



	Site Staff	
Company	Individual	Title
Haley & Aldrich	Sebastian Sotomayor	Field Manager
Haley & Aldrich	Kassidy O'Connor	Field Staff
Entact	Wyatt Seel	Field Engineer
Entact	Austin Farmerie	Field Engineer
Entact	Brent Hayes	Field Project Manager
Entact	Tariq Smith	SSHO
Entact	Jeramy Leibrant	Operator
Entact	Ross Deambrogo	Field Manager
EA Engineering	Thomas Irvine	Site Inspector
EA Engineering	Joe Kowalski	Site Inspector
	Site Equipment	
Name	Contractor	Quantity
Komatsu WA 380	Entact	1
Caterpillar 289D	Entact	1
Skid Steer	Entact	1
Chicago Pneumatic	Entact	1
Generator (CPG)	Liitact	<u> </u>
Caterpillar 336E Excavator	Entact	2
Pavement Saw	Entact	1
Light Tower	Entact	1
Godwin Pumps	Entact	2
Water Truck	Entact	1
Long Stick Caterpillar	Entact	1
Excavator 336E	Lintaet	-
Hydro Vac Truck	Entact	1
Caterpillar Dozer D6	Entact	1
Caterpillar Rock Truck 740	Entact	1
Caterpillar Excavator 314	Entact	1
United Rental Frac Tank	United Rental	1
Rusmar Foam Machine	Entact	1
Caterpillar Compactor 950	Entact	1



Site Photographs:

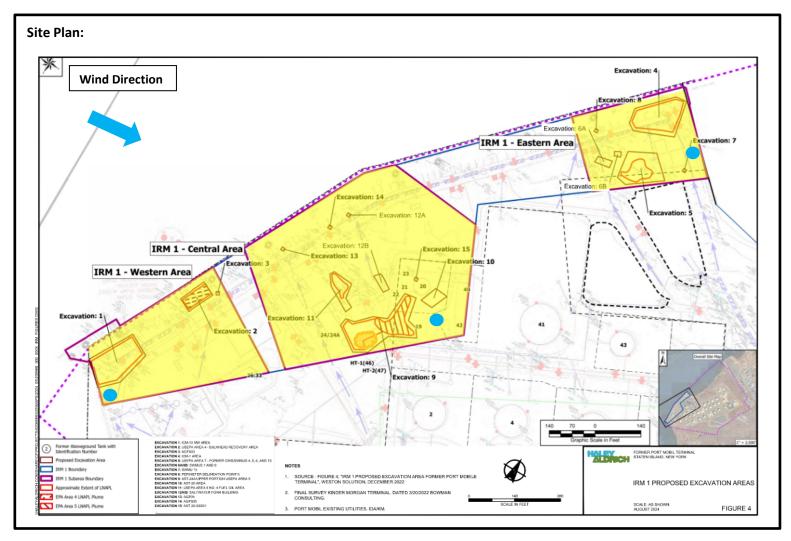


Photo 1: View of truck washing activities in IRM 1 Central Area, facing west.



Photo 2: View of truck loading from Excavation 9 stockpile, IRM 1 Central Area, facing northwest.





Reference: Interim Remedial Measures 1 Work Plan Figure 7B IRM-1 Central Area Proposed Excavation Area, prepared by Haley & Aldrich of New York, dated May 2024





4101 Arthur Kill Rd, Staten Island, New York, 10309

Air Monitoring Log

Date: 2024-11-01

Personnel: S. Sotomayor, K. O'Connor

Weather: Sunny, 57-66°F

Humidity: 54%

Wind Direction: SE to NW, 11 mph

Particulate Background (ug/m3):6.190

PID Background (ppm): 0.0

Action Levels : <u>Downwind perimeter of work area above background levels</u>

PID (ppm): > 5 ppm for the 15-min average

Dust (ug/m3): > 150 for the 15-min average

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. PM10 (Station4)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Avg. VOC(Station4)	Odors	Notes Activities/ Additional Monitoring
06:30	5.600	6.190				0.0				
06:45	5.877	4.492	14.280		0.0	0.0	0.0			
07:00	8.424	4.409	17.863		0.0	0.0	0.1			
07:15	6.469	4.188	14.876		0.0	0.0	0.0			
07:30	5.595	4.064	16.156		0.0	0.0	0.0			
07:45	9.553	3.825	16.454		0.0	0.0	0.0			
08:00	9.458	6.286	16.281		0.0	0.0	0.1			
08:15	9.122	6.381	11.776		0.0	0.0	0.1			
08:30	8.286	6.690	8.378		0.0	0.0	0.2			
08:45	9.074	5.455	12.205		0.0	0.0	0.2			
09:00	7.111	6.149	13.170		0.0	0.0	0.2			
09:15	8.201	6.975	8.961		0.0	0.0	0.1			
09:30	5.985	4.982	6.661		0.0	0.0	0.0			
09:45	5.435	5.003	7.637		0.0	0.0	0.1			
10:00	4.633	4.805	10.184		0.0	0.0	0.1			
10:15	5.443	3.999	17.410		0.0	0.0	0.2			
10:30	4.847	4.061	30.877		0.0	0.0	0.6			
10:45	4.308	4.218	32.113		0.0	0.0	0.3			

4101 Arthur Kill Rd, Staten Island, New York, 10309

Air Monitoring Log

Minute of Time	Avg. PM10 (Station1)	Avg. PM10 (Station2)	Avg. PM10 (Station3)	Avg. VOC(Station1)	Avg. VOC(Station2)	Avg. VOC(Station3)	Odors	Notes Activities/ Additional Monitoring
11:00	6.536	4.051	27.461	0.0	0.0	0.3		Worldoring
11:15	4.311	4.087	34.301	0.0	0.0	0.2		
11:30	3.533	3.894	32.444	0.0	0.0	0.2		
11:45	3.221	3.732	27.927	0.0	0.0	0.2		
12:00	8.538	3.295	47.476	0.0	0.0	0.2		
12:15	16.558	3.134	8.121	0.0	0.0	0.1		
12:30	13.311	2.924	52.009	0.0	0.0	0.1		
12:45	9.037	2.881	11.139	0.0	0.0	0.1		
13:00	10.501	2.901	76.123	0.0	0.0	0.2		
13:15	8.779	2.457	85.023	0.0	0.0	0.1		
13:30	114.151	2.695	129.071	0.0	0.0	0.2		
13:45	33.515	2.433	19.777	0.0	0.0	0.1		
14:00	34.167	2.126	20.403	0.0	0.0	0.3		
14:15	18.729	2.085	32.227	0.0	0.0	0.3		
14:30	21.334	1.891	24.872	0.0	0.0	0.2		
14:45	21.278	1.995	12.845	0.0	0.0	0.1		
15:00	23.897	1.722	10.279	0.0	0.0	0.1		
15:15	23.066	1.814	20.548	0.0	0.0	0.0		
15:30	25.572	1.918	70.061	0.0	0.0	0.1		
15:45	22.147	1.914	18.460	0.0	0.0	0.0		
16:00	18.550	1.670	6.010	0.0	0.0	0.0		
16:15	19.070		5.090	0.0		0.0		