

315-463-1643 OP TECH *Canj*716-937-6527 *Natures way*315-455-1625 *Action*

INSPECTOR'S DAILY REPORT

New York State Department of Environmental Conservation

Division of Environmental Remediation

Date 11/18/03R. No. NYSEG11803315 249 4500 *Agar* 315 447 8516 *Dick Brazell*Site Name: Ithaca Court StreetSite Code: 7-55-008T & A Code: A381Location: Court Street, Ithaca NYDEC Project Manager: Bill Ottaway

Engineer / Consultant:

Contractor: SevensonHealth & Safety: PPE Level D ☒ C ☐ B ☐ Modified D in Trench

Description of Work Performed:

Excavating in front of #616 Court St., Green / Grey silty clay with MGP odor encountered @ $\approx$ 1.5'-2' bg. 10 mph wind gusts (South)

2 trailer dumps and 1 triaxle loaded by 10:30 am

Excavating to $\approx$ 4' bg above water main, then dipping down to 7.5'-8.0' bg north side of water main. Soil is stained and odorous left above water main. Soil @ 8' depth is green / grey some MGP odor but no staining.

Hit water main @ 11:10 am, excavation stopped. Water is filling up excavation, Sevenson is pumping and containerizing contaminated water. The water is then trucked to frac tank @ trailer location.

John R. is trying to get water main shut down. AK called OP Tech to send vacuum truck ASAP.

Steve Mayke (DOH) on site to inspect water main break. John Anderson 607-274-6688

John Raspantini on site for NYSEG

Brian Belchikovis for AES Monitoring

Ithaca Court Street

I.R. No. NYSEG 111803


Description of Work Performed:

3/4" - 1" hole cut into water main from bucket of excavator.

OP-Tech and Gary Dyer Vacuum trucks called on site to vacuum up contaminated water.

City of Ithaca Water Dept. approved repair on line.

Approx. 2' of cont. material on N side of water line left behind under gas line running perpendicular to water main. The last truck was filled before all material could be removed. Truck was filled @ 11:15 hrs.

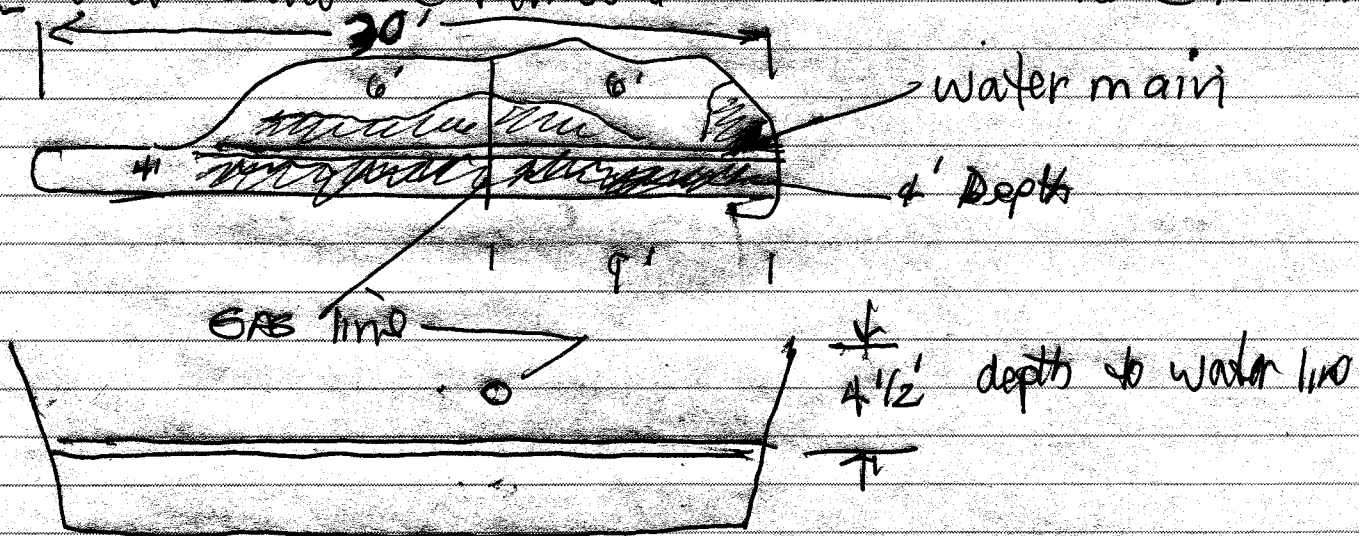

Steve Cross Clean Harbors

Gary Bustin - OP Tech 3 Vac Truck Operators

Mike Dean - Gary Dyer

Items of Concern:

No contingency for broken water lines!?

Inspector's Name: Anthony Karwiel

Inspector's Signature: Anthony Karwiel

Date: 11/18/03