


New York State Department of Environmental Conservation
Division of Environmental Remediation - Central Office
Bureau of Construction Services
Field Support Unit

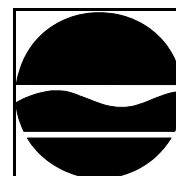

Erin Crotty
Commissioner

DAILY INSPECTION REPORT

Site Code #: 7-55-008	Date: July 23, 2004	Report #: NYSEG072304
------------------------------	----------------------------	------------------------------

Site Name: NYSEG Ithaca Court St. - Wooden Duct Removal

Location: Ithaca, Tompkins Co.

NYSEG Proj. Mgr.: Bert Finch

DEC Proj. Mgr.: Bill Ottaway

Consultant Proj. Mgr.: Dave Budosh (URS)

Proj. Contr.: Severson

Site Phone & Fax:

	AM	PM
Weather	Overcast	Rain
Temperature	70s	70s
Wind Direction	Calm	

Description of work performed by contr. this report period:

- Contractor excavated material from middle and south side of court street. Material removed to a depth of 10 feet, including old sewer line. All visible contamination removed. Backfilled with clean material, installed new sewer line and tied in to residences. Approximately 100 tons contaminated materials excavated. Rainfall from previous night caused excessive groundwater inflow into trench, exceeding the rate at which water could be pumped out. Contractor had 5 trailers on order for waste hauling, but only 3 were used, with the remaining trucks sent back empty.

Description of inspections performed by engr. this report period:

•

Discussions/comments regarding visitors, contractor and/or engineer:

- Discussed de-watering methods with URS and NYSEG personnel.

Change Orders:

•

Sampling and Analyses:

- Confirmation samples taken by URS. Sidewall: SW 1100, and Bottom: B 1050.

Major Issues	Description & Reason
Excavation de-watering	Contractor pumping water from east (dirty) end of trench into vac truck, but also pumping water from west ("clean") end of trench directly into city storm sewer (on corner of Meadow and Court St). Mr. Budosh (URS) agreed to terminate this practice.

Health & Safety:

Level of protection: Normal.

Is the level of protection in conformance with the approved Health & Safety Plan? Yes.

List deviations:

Are atmospheric monitoring results acceptable? Yes.

Site Visitors	Representing	Entered Exclusion Zone
Walter Savichky	NYSEG	Perimeter (trench rim)

Contractor's Information:

Subcontractor	Activity	Hours Worked
Page	Hauling excavated mat'l	

Equipment	P	1	2	3	Personnel	P	1	2	3
Komatsu W140 backhoe	1				Supervisor	1			
Komatsu PW 170ES excavator	1				Operator	2			
Tractor Trailer		3			Laborer	2			
Loader	1				Teamster		5		
Vac Truck	1				Health & Safety	1			

NYSDEC Site Representative: Tom Festa

Date: July 23, 2004

Representative's signature:

Reviewed By:

Date: