

May 20, 2025

Ms. Kathryn Lovell
New York State Department of Environmental Conservation
Division of Environmental Remediation, Region 8
6272 East Avon-Lima Road
Avon, New York 14414

Re: Monthly Monitoring Report – April 2025
1000 Turk Hill Road, Fairport, New York
NYSDEC Site ID No. 828161

Dear Ms. Lovell:

On behalf of New Coleman Holdings, Inc., Roux Environmental Engineering and Geology, D.P.C. (Roux) has prepared this Monthly Monitoring Report (MMR) to summarize the ongoing monitoring and remediation activities, including operation and maintenance of the sub-slab depressurization systems (SSDSs), at 1000 Turk Hill Road, Fairport, New York. Roux has engaged a local subcontractor (Trec Environmental Inc. [Trec]) to perform the monthly monitoring of the SSDSs.

The MMR for March 2025 was submitted to the New York State Department of Environmental Conservation (NYSDEC) and the New York State Department of Health (NYSDOH) on April 11, 2025.

SSDS Monitoring

The monthly SSDS monitoring event was performed by Trec on April 28, 2025. Eight of the 12 SSDS vacuum monitoring points were inspected, measured, and confirmed to be operating within the pre-established parameters. During the visit, the monitoring points associated with Systems B2, C1 and C2 in Building 1 (located in Wonder Repair and the vacant space formerly Nat's Nuts) and System A in Building 3 (located in the men's bathroom) could not be accessed. The vacuum measurements from all accessible monitoring points were consistent with previous monitoring events and within the required performance ranges for those systems.

The exterior components of each of the five SSDSs on Building 1 and Building 3 were also inspected. As previously noted, the mounting brackets for System A in Building 3 are broken, but the vent pipe remains fastened and will continue to be inspected monthly to ensure operation is not impacted.

The vacuum measurements and other pertinent information documented during the inspection are provided on the attached Monthly SSDS Monitoring and Inspection Checklist – April 2025 (Table 1). The locations and designations of the various SSDS systems and monitoring points are shown on the attached SSDS As-Built Drawings prepared by Envirosafe Inspections & Consulting (Attachment 1).

The next SSDS monitoring event is planned to occur during the week of May 26, 2025, and will be documented in a future Monthly Monitoring Report.

Remedial Injection Program

Work related to the remedial injection program is ongoing. The second groundwater performance monitoring event to evaluate the injection program performance was completed between April 21 and 23, 2025. The laboratory analytical results were shared with you on May 12, 2025 and a full summary


Ms. Kathryn Lovell
May 20, 2025
Page 2

report will be submitted to you once the data is validated and complied. The 2nd Phase of the remedial injection program is scheduled to be performed the week of June 16, 2025.

If you have any questions or require additional information, please do not hesitate to contact me at (917) 825-1108 or via email at masmith@rouxinc.com.

Sincerely,

ROUX ENVIRONMENTAL ENGINEERING AND GEOLOGY, D.P.C.

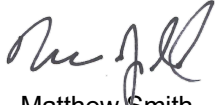

Matthew Smith
Senior Scientist I

ROUX ASSOCIATES, INC.



Christopher Battista, P.G.
Principal Scientist

Attachments

cc: Anthony Perretta, NYSDOH
Charlotte Theobald, NYSDEC
Charles J. Sgro, New Coleman Holdings, Inc.
Allie LeBlanc, New Coleman Holdings, Inc.
Steve Russo, Esq., Greenberg Traurig, LLP
Omar Ramotar, P.E., Roux Associates, Inc.

Table 1. Monthly SSDS Monitoring and Inspection Checklist - April 2025
 Turk Hill Park, 1000 Turk Hill Road, Fairport, New York - NYSDEC Site No. 828161


Building 1									
Building 1	Tenant / Location	Date	Time	Baseline Manometer Reading (In. W.C.) 1/29/18	Current Manometer Reading (In. W.C.)	Evidence of Water/ Condensation Accumulation	Is The Fan Operating as Expected?	Is Any of The Piping Damaged or Disconnected?	Comments
System A	Canal Metalsmith	4/28/2025	2:00 PM	2.4	2.2	N	Y	N	
System B1	Wonder Repair & Floor Coverings	4/28/2025	2:30 PM	1.0	N/A & 1.0	N	Y	N	Fairport Computer is now Floor Coverings.
System B2	Wonder Repair	4/28/2025	2:40 PM	1.0	N/A	N	Y	N	No access.
System C1	Vacant (Formerly Nat's Nuts)	4/28/2025	2:55 PM	0.9	N/A	N	Y	N	No access to the vacant tenant space.
System C2	Vacant (Formerly Nat's Nuts)	4/28/2025	2:55 PM	1.0	N/A	N	Y	N	No access to the vacant tenant space.
System D	Amazing Grains Bread Company	4/28/2025	3:05 PM	2.8	2.4	N	Y	N	
System E	Amazing Grains Bread Company	4/28/2025	3:15 PM	1.9	1.8	N	Y	N	
Building 3									
Building 3	Tenant / Location	Date	Time	Baseline Manometer Reading (In. W.C.) 1/29/18	Current Manometer Reading (In. W.C.)	Evidence of Water / Condensation Accumulation	Is The Fan Operating as Expected?	Is Any of The Piping Damaged or Disconnected?	Comments
System A	Men's Bathroom	4/28/2025	3:25 PM	2.5	N/A	N	Y	N	No access, entry door was locked.
System B	Loading Dock	4/28/2025	3:35 PM	1.9	2.0	N	Y	N	
System C	Former Spartacus (tenant space)	4/28/2025	4:00 PM	2.2	2.2	N	Y	N	
System D	Millwork Shop	4/28/2025	3:45 PM	2.8	2.6	N	Y	N	
System E	CrossFit Fairport	4/28/2025	4:00 PM	2.8	2.5	N	Y	N	

Notes:

N/A - Not Available

NM - Not Measured

In W.C. - inches of water column

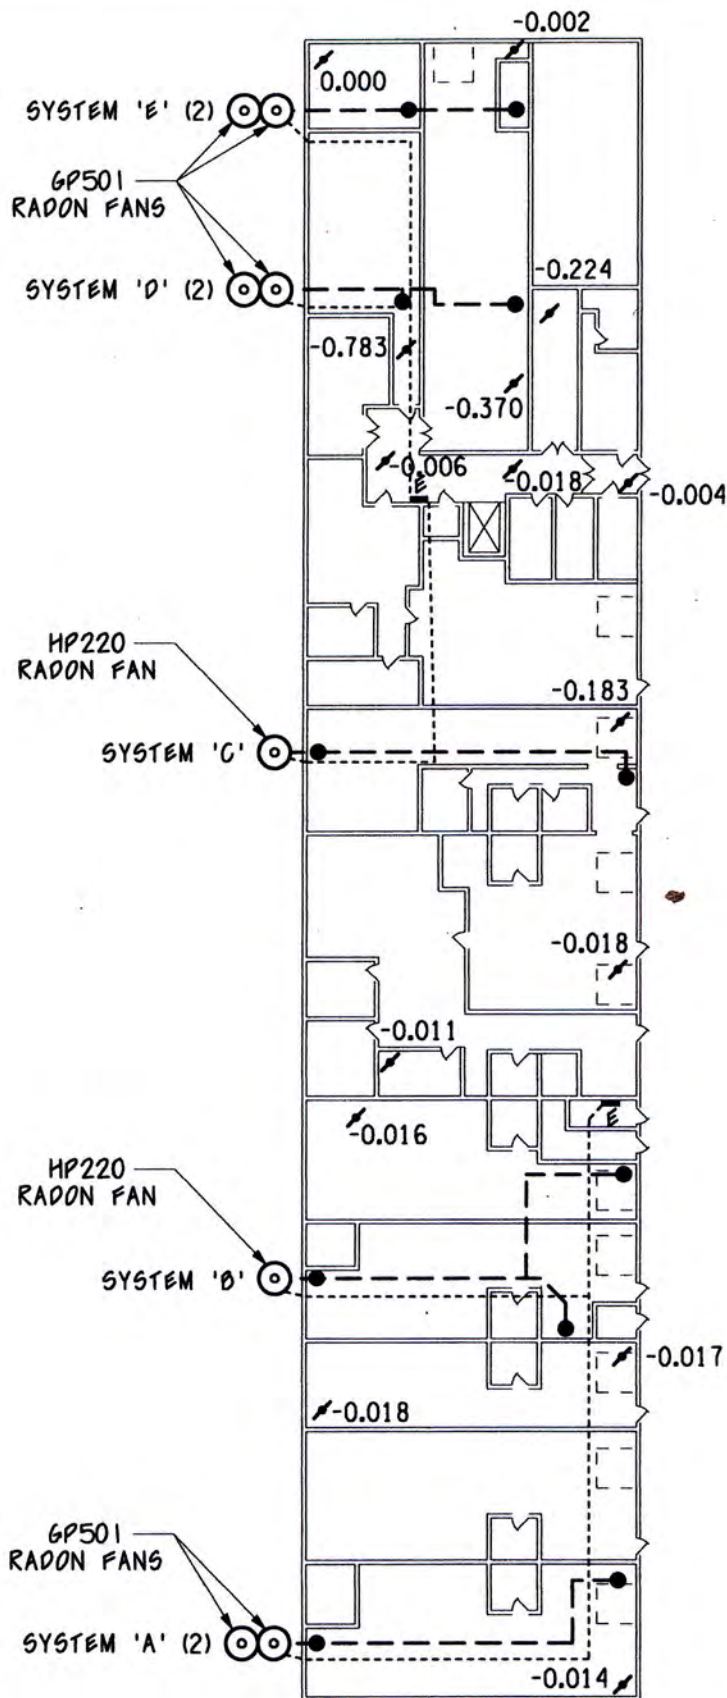

Sub Slab Depressurization Systems

Building 1
1000 Turk Hill Road
Fairport, NY



Bruce W. Finster, P.E.

NOTES:

- - SUCTION POINT
- / - 1/2" TEST HOLE
- EP - ELECTRIC PANEL
- - ELECTRIC LINE
- - SCH. 40 PVC PIPE



Envirosafe Inspections & Consulting


PO Box 671

Honeoye, NY 14471

585-704-4385

www.envirosafeinspections.com

Figure 1

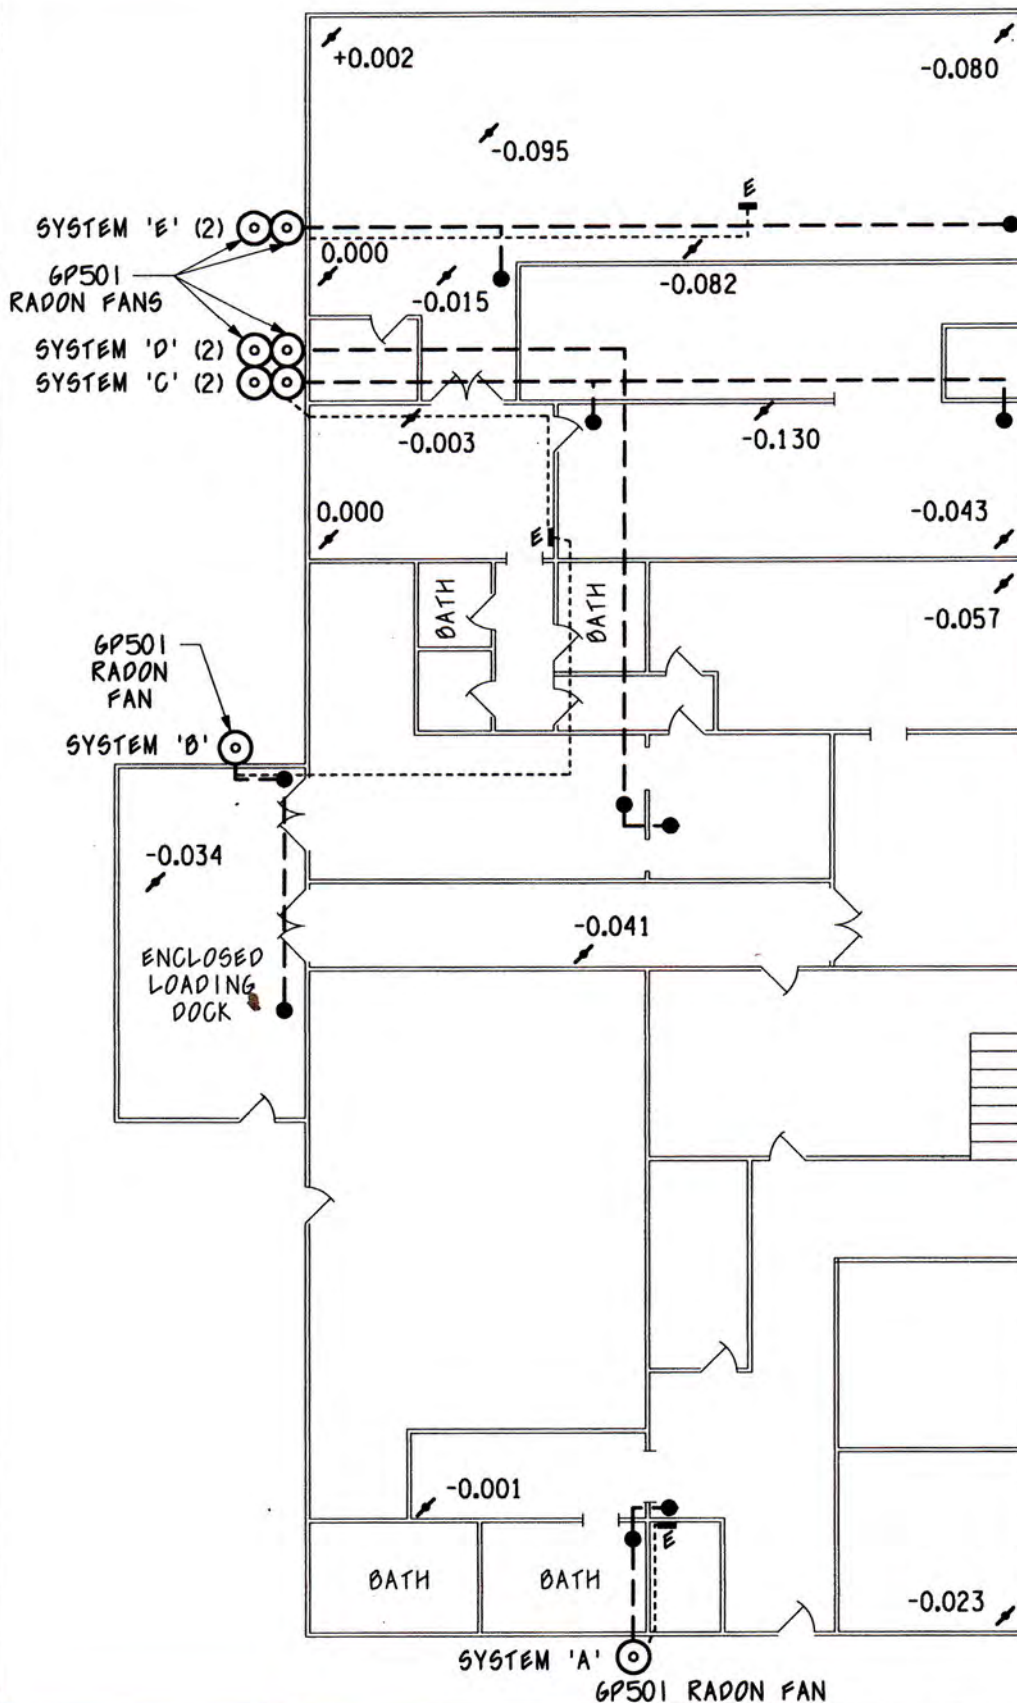

**Sub Slab
Depressurization Systems**

Building 3
1000 Turk Hill Road
Fairport, NY



Bruce W. Finster, P.E.

NOTES:

- • SUCTION POINT
- ⌘ • 1/2" TEST HOLE
- E • ELECTRIC PANEL
- • ELECTRIC LINE
- • SCH. 40 PVC PIPE



Envirosafe Inspections & Consulting
PO Box 671
Honeoye, NY 14471
585-704-4385
www.envirosafeinspections.com

Figure 2