



**NYSEG - MGP SITE**  
**Penn Yan, New York**

**Construction Manager Weekly Reports**

**DATE:** Week ending 06/11/17

<b>WEEK NO.:</b> 97	<b>HOURS ON SITE:</b> 10/day	<b>WRITTEN BY:</b> Abby Chin	<b>PROJECT NUMBER:</b> 60430543	
<b>Weather:</b> Variable, 48°F to 75°F				
<b>NAME:</b>	<b>TRADE:</b>	<b>COMPANY:</b>	<b>EQUIPMENT:</b>	<b>VISITORS/AFFILIATION:</b>
George Fischer	Construction Oversight	AECOM	5 Barges	Emily Thurston - D&B Engineers (NYSDEC)
Skylar Haas	CAMP Monitoring	AECOM	Smooth Drum Roller	Ray Spencer - Neighboring Property Owner
Chester Adams	Superintendent	SES	31EX Dozer	
Anthony Laurendi	Site Safety Officer	SES	Air compressor	
William Conti	Laborer	SES	Push Boat	
George Schell	Operator	SES	Excavator with Hammer	
Tim Sheehan	Laborer	SES	320 zero turn excavator	
Kevin Daunce	Operator	SES	2 Floats	
Robert Boland	WWTP	SES	PC360 Excavator	
Zachary Rose	Laborer	SES	Komatsu W380 Loader	
Derek Stein	Laborer	SES	Sky Jack High Reach Fd	
Andrew Stein	Laborer	SES	3 Scows	
			PC 300 Excavator - LF	
			Push Boat	
AECOM Site hours this week - 66 est.				
<b>SUBCONTRACTORS:</b>		<b>SITE DELIVERIES (indicate size, type, and condition):</b>		
<b>WORKED PERFORMED BY Sevenson Environmental Services (SES)</b>				
<b>06/05/2017</b> - Removed berm from TFS barge slip area. Began taking apart working platform in the Keuka Lake Outlet. Removed crane mats from the working platform and stockpiled on site. Removed two floats from the Outlet and began deconstructing spuds. Continued to perform site maintenance. Continued maintenance of sidewalks and roads, implementing traffic control during delivery of materials.				
<b>06/06/2017</b> - Continued removal of working platform from the Keuka Lake Outlet. Removed spud pockets, power pack, hoses and remaining crane mats from the barges. Removed 2 additional floats from the Keuka Lake Outlet. Assisted ADMAR with demobilization of historic building investigation equipment. Continued to perform site maintenance. Continued maintenance of sidewalks and roads, implementing traffic control during delivery of materials.				
<b>06/07/2017</b> - Removed all Sevenson equipment from the Keuka Lake Outlet. Staged spud pockets, power pack, hoses and remaining crane mats in Sevenson laydown yard. Demobilized JCB 535 and mini excavator from the site. Began preparation for welding 22' sheetpile by grinding sheets for weld joints. Continued to perform site maintenance. Continued maintenance of sidewalks and roads, implementing traffic control during delivery of materials.				
<b>06/08/2017</b> - Following removal from the outlet, staged floats on asphalt pad. Assisted ADMAR in demobilization of building investigation equipment. Cleaned and reorganized pad in preparation for demobilization from the site. Continued preparation for welding 22' sheetpile by grinding sheets for weld joints. Continued to perform site maintenance. Continued maintenance of sidewalks and roads, implementing traffic control during delivery of materials.				



**NYSEG - MGP SITE**  
**Penn Yan, New York**

**Construction Manager Weekly Reports**

**DATE:** Week ending 06/11/17

<b>WEEK NO.:</b> 97	<b>HOURS ON SITE:</b> 10/day	<b>WRITTEN BY:</b> Abby Chin	<b>PROJECT NUMBER:</b> 60430543
<b>WORK COMPLETED BY SES SUBCONTRACTORS</b>			
<b>AGREEMENTS MADE/CONVERSATIONS (Refer to telecons, phone records, and/or logbooks for details)</b>			
Weekly meeting held 6/6/17. See minutes for details.			
Conference call held on 6/7/17 with NYSEG, AECOM, and DEC to discuss permitting issues during the project shutdown.			
Conference call held on 6/8/17 with NYSEG, AECOM, and Village of Penn Yan to discuss the construction schedule of the footbridge.			
<b>SAMPLING PERFORMED:</b>			
<b>QUALITY CONTROL ACTIVITIES</b>			
Ongoing erosion control inspections. Erosion control measures repaired as necessary.			
<b>REQUEST FOR INFORMATION (RFI)</b>			
<b>TRANSMITTALS / SUBMITTALS</b>			
Submittals reviewed and approved as noted in submittal register.			
<b>VIBRATION/SETTLEMENT MONITORING COMMENTS:</b>			
Settlement monitoring continues, very little movement observed at crack gauges. Have seen some temperature related movement. Variations within GeoKon system measurements were seen due to contact with system components. Sensor SP-07 has been re-connected to the system following completion of the building investigation. Data will be reviewed and the system will be re-set if necessary. Data from Leica system shows normal temperature related oscillation.			
Vibration monitoring is conducted daily within the former MGP structure and Water Street Wines & Spirits building. Several vibration alert exceedances due to work within the building.			
Turbidity monitoring conducted daily. No turbidity exceedances observed.			
<b>AIR MONITORING COMMENTS:</b>			
AECOM on site performing CAMP and noise monitoring. No CAMP exceedances observed.			
<b>SAFETY OBSERVATIONS/VIOLATIONS/COMMENTS</b>			
SES performing daily toolbox safety meetings. Approximately 46,720 site hours worked to date without incident.			
<b>CORRECTIVE ACTIONS IMPLEMENTED</b>			



NYSEG - MGP SITE  
Penn Yan, New York

Construction Manager Weekly Reports

DATE: Week ending 06/11/17

WEEK NO.: 97

HOURS ON SITE: 10/day

WRITTEN BY: Abby Chin

PROJECT NUMBER: 60430543

PHOTOS



Crew removing work platform float



Sheet in grinding stage of preparation for splice weld



Inside building floor covered with poly after investigation



Crew rigging a float for removal from Keuka Lake Outlet

STREAM STAGE MONITORING

DATE	WATER LEVEL (FROM KLA WEBSITE)
6/5/2017	713.91
6/6/2017	713.89
6/7/2017	713.93
6/8/2017	713.95
6/9/2017	713.96
6/10/2017	713.96
6/11/2017	713.97

Construction  
Manager (Signature):

Project Construction Week: 06/05/2017-06/08/2017

Report Date: 6/19/2017

**NYSEG**

**Penn Yan Former MGP Site Remedial Action**

**Penn Yan, New York  
NYSDEC Site No. 8-62-009**

**Weather**

Monday 06/05/2017: High 70.1° Cloudy, with 0.45" of rain and an average of 1.1 mph winds (Max 10.0 mph) directed in the southwest direction.

Tuesday 06/06/2017: High 66.4° Cloudy, with 0.10" of rain and an average of 1.9 mph winds (Max 16.0 mph) directed in the southwest direction.

Wednesday 06/07/2017: High 69.8° Clear, with 0.00" of rain and an average of 2.0 mph winds (Max 12.0 mph) directed in the southwest direction.

Thursday 06/08/2017: High 77.8° Partly cloudy, with 0.00" of rain and an average of 1.8 mph winds (Max 9.0 mph) directed in the southwest direction.

**Air/Noise Monitoring Levels within limits: Yes**

**Comments/Responses:**

Equipment	ID	Station	Last Calibration
DustTrak II 8530	8530163902	Unit 1	9/20/2016
DustTrak II 8530	8530133403	Unit 2	3/7/2017
DustTrak II 8530	8530121503	Unit 3	4/12/2017
CEL-352 Noise Dosimeter	3111305	Canal, Water Street	Daily
MiniRAE 3000	592-907919	Unit 1	4/17/2017
MiniRAE 3000	592-907667	Unit 2	4/17/2017
MiniRAE 3000	592-906598	Unit 3	4/17/2017

NA-Not Available

**Consultant's Verification:** On behalf of the Consultant, I certify this report is complete and correct, and all materials and equipment used and work performed during this reporting period are in compliance with the contract plans and specifications, to the best of my knowledge, except as may be noted above.



**Abby Chin**  
**CAMP Review Personnel/ Signature**

6/21/2017

**Date**



## WEEKLY CAMP & NOISE REPORT

Project Construction Week: 06/05/2017-06/08/2017

Report Date: 6/19/2017

### **ATTACHMENT #1 CAMP DATA**

Table 1: Particulates Data

Date	Particulate Action Level (ug/m3)	Unit 1 Peak Particulates (µg/m³)	Unit 2 Peak Particulates(µg/m³)	Unit 3 Peak Particulates(µg/m³)	Comments
6/5/2017	150	-	-	-	No data collected due to rain
6/6/2017		-	-	-	No data collected due to rain
6/7/2017		20	7	10	
6/8/2017		-	-	-	No intrusive work on site - no data collected

- 1. NA-Not Available.
- 2. All particulates data is presented as 15 minute peak averages.
- 3. **Bold** indicates recording in excess of alert level.
- 4. **Bold and highlighted** indicates recording in excess of stop work level.

Table 2: Noise Data

Date	Noise Action Level (dB)	Peak Noise (dB)	Comments
6/5/2017	90	56.6	
6/6/2017		59.7	
6/7/2017		58.2	
6/8/2017		57.1	

- 1. NA-Not Available.
- 2. **Bold** indicates exceedance observed.

Table 3: VOC Data

Date	VOC Action Level (ppm)	Unit 1 Peak VOC (ppm)	Unit 2 Peak VOC (ppm)	Unit 3 Peak VOC (ppm)	Comments
6/5/2017	5.0	-	-	-	No data collected due to rain
6/6/2017		-	-	-	No data collected due to rain
6/7/2017		-	4.355	0.596	No site source identified, logging failure due to machine error. NW (Unit 1) didn't log due to pump failure.
6/8/2017		-	-	-	No intrusive work on site - no data collected

- 1. NA-Not Available.
- 2. All VOC data is presented as 15 minute peak averages.
- 3. **Bold** indicates recording in excess of alert level.
- 4. **Bold and highlighted** indicates recording in excess of stop work level.




## WEEKLY CAMP & NOISE REPORT

Project Construction Week: 06/05/2017-06/08/2017

Report Date: 6/19/2017

### **ATTACHMENT #2 CAMP STATION LOCATIONS**



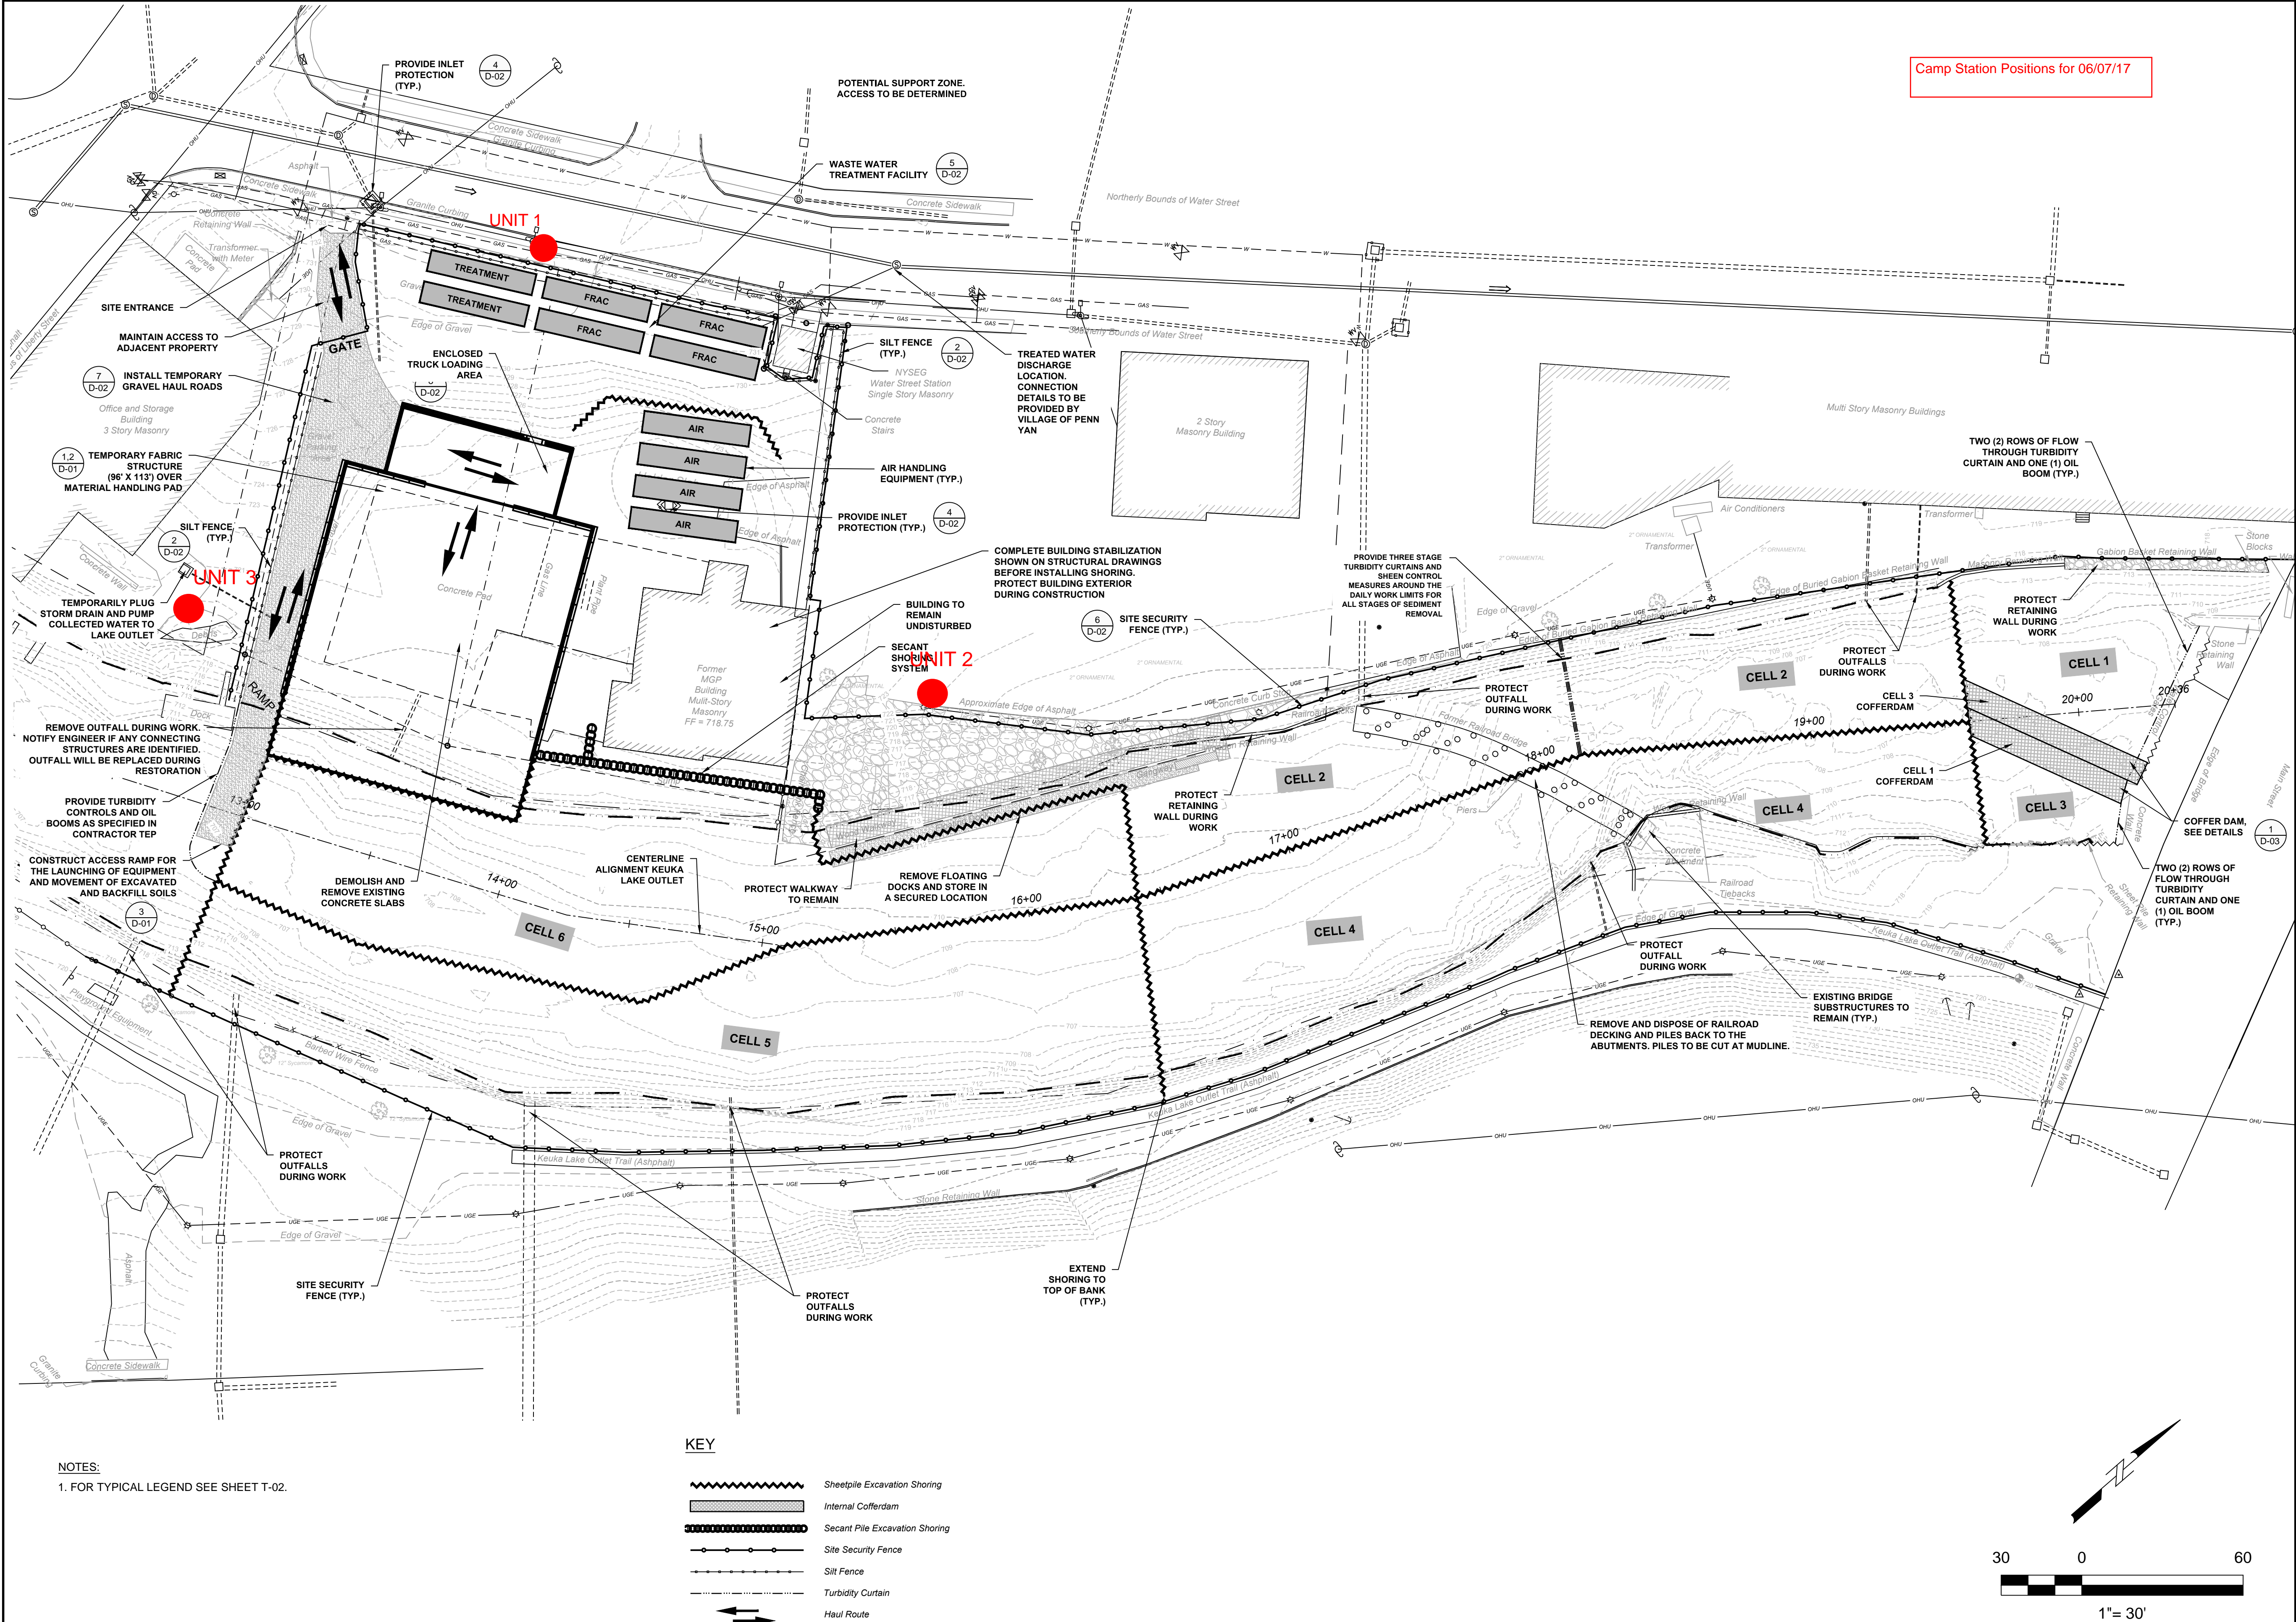

ISSUE/REVISION		
0	02-06-15	ISSUED FOR CONSTRUCTION
I/R	DATE	DESCRIPTION



	Upstream Low	Upstream High	Downstream Low	Downstream High	Within Reporting Limits	Working Day
Date	NTU	NTU	NTU	NTU	( Yes/No )	(Yes/No)
<b>6/5/2017</b>	2.3	25.2	1.2	34.4	Yes	Yes
<b>6/6/2017</b>	2.2	7.3	0.3	11.6	Yes	Yes
<b>6/7/2017</b>	2.5	4.7	0.6	9.6	Yes	Yes
<b>6/8/2017</b>	2.4	4	7.4	10.8	Yes	Yes
<b>6/9/2017</b>	2.6	5.6	9.2	11.1	Yes	No
<b>6/10/2017</b>	2.9	4.4	10.2	12.9	Yes	No
<b>6/11/2017</b>	2.9	5.6	10	11.1	Yes	No

High and Low values reported each 24 hr period for each day.

Reporting Limits: exceedance recorded if downstream value exceeds upstream value by 100NTU.

**Shaded and Bold cells indicate turbidity reading exceeded reporting limits.**



## Daily Progress Report

NYSEG PENN YANN

### Report Date

June 5, 2017

### Day of the Week

Monday

### Report No.

332

### Project No.

P1138

### Weather High

68°F

### Weather Low

55°F

### Precipitation

0.0

### Weather Conditions



Partly  
Cloudy

### Photo 1



Sevenson removing berm from TFS barge slip area and stockpiling on-site.

### Photo 2



Removing crane mats from working platform utilizing PC220.

**Photo 3**



Stockpiling crane mats from the working platform on-site.

**Photo 4**



Removing one 40' x 10' float from the TFS barge slip and placing on asphalt pad for storage.

### **Video**

**No video uploaded.**

### **Work Performed by Severson**

- Removed berm from TFS barge slip area.
- Began taking apart working platform in the Keuka Lake Outlet.
- Removed crane mats from the working platform and stockpiled on site.
- Removed two floats from the Outlet and began deconstructing spuds.
- Continued to perform site maintenance.
- Continued maintenance of sidewalks and roads,

### **Planned Activities**

- Begin welding structural sheetpile.
- Complete installation of structural sheeting.
- Begin plantings within the Keuka Lake Outlet prior to June 30th deadline.

implementing traffic control during delivery of materials.

### **Safety Remarks**

-No accidents or incidents were reported.  
-Conducted daily safety meeting at 7:00 AM  
Safety Topic: Pinch Points

### **Work Performed by Subcontractors**

-No subcontractors were on-site.

### **Remarks/Verbal Directives**

-None.

### **Equipment/Materials Delivered to Site**

-No equipment or materials were delivered to the site.



### Miscellaneous Information

-None.

### Contractor Equipment List

EQUIPMENT NAME	MAKE/MODEL	MOB DATE	DEMOB DATE
Bulldozer 408E	41 EX Dozer	11/18/15	
Smooth Drum Roller 315E	IR SD-115 D Roller	12/08/15	
Excavator 783E	PC 220	11/23/15	
Excavator 563E	PC300	2/23/16	5/8/17
Excavator 1052-13	PC300 LF	8/24/16	
Air Compressor 808E		2/23/16	
Loader 1124E	Komatsu WA 380	2/25/16	
P218M Barge	Working Platform 50' x40'	4/6/16	
P215M Barge	Working Platform 50' x40'	4/6/16	
P229M Barge	Working Platform 50' x40'	4/6/16	
P259M Barge	Working Platform 50' x40'	4/6/16	
P115O Barge	Working Platform 50' x40'	4/7/16	

1116-92	Winch Power Pack 80hp Poseidon	4/21/16
1287-92	Hydraulic Spud Winch	4/21/16
1904E Scow		4/18/16
996EF Float		4/18/16
Float		4/18/16
541E Scow	Single Scow	4/19/16
540E Scow	Single Scow	4/19/16
535E JCB		5/16/16
1037-12 320 Zero Turn		9/19/16
1313-82 Push Boat	J-Boat Utility	7/21/16
1031-90	Terex RL 4000 Light Plant	9/6/16
970-90	IR Light Plant	9/6/16
1718E	Water Treatment Trailer	8/31/16
1818E	Mixing Tank	8/30/16
1816E	Mixing Tank	8/30/16
1408E	Bag Filter	9/7/16
1714E	Bag Filter	9/7/16
TW1253	Polisher	9/8/16
TW1252	Polisher	9/8/16
838E	Dump Truck	11/2/16
600-13	PC360	1/17/17
205-60E	Dump Truck	11/2/16

## Rental Equipment List

EQUIPMENT NAME	MAKE/MODEL	DESCRIPTION	MOB DATE	QUANTITY	EQUIP #	HOURS
-------------------	------------	-------------	-------------	----------	------------	-------

Dumpster	Riccelli	40 CY Rolloff	7/14/15	1
Porta-Jon's	Larry's Latrines		7/14/15	3
Office Trailer	Modspace	60' x 12'	3/22/16	1
Office Trailer	Modspace	44' x 10'	3/23/16	1
VM Hammer	PVE		4/24/17	1
60 LB Hammer	Toku TPB60	Breaker	5/10/17	1
Mini Excavator	Takeuchi	TB228R	5/12/17	1
Mini Track Loader	Toro		5/18/17	1
Electric Core Machine	DP		5/18/17	1
90 LB Hamer	Toku TPB90	Breaker	5/10/17	1

### Labor - Sevenson

# OF PERSONNEL	TYPE OF PERSONNEL	HOURS WORKED
1	Project Engineer	10
1	Project Superintendent	10
4	Operator	40
4	Laborer	40
1	DEC	10
3	AECOM	30

### Labor - Sub Contractors

SUB CONTRACTORS	HOURS WORKED
Woodford Brothers	0
Mertec	0
Thew Associates	0

### Labor Totals

### Today's Sevenson

Labor Total: 140

Today's Contractor  
Labor Total: 0

Today's Total  
Labor Hours: 140

Total Project Labor  
Hours To Date:  
46300

### Attachments

No Attachments  
Uploaded

### Report Completed By

First Name

Last Name

Anthony

Laurendi



Report Date

Day of the Week

Report No.

Project No.

June 6, 2017

Tuesday

333

P1138

Weather High

Weather Low

Precipitation

Weather  
Conditions

63°F

48°F

0.3



Rain

Photo 1



Removing barges from the outlet and stockpiling on the asphalt pad.

Photo 2



Unpinning the barges for removal of each float from the outlet.

Photo 3



Severson assisting with demobilization of building investigation equipment.

Photo 4



Detaching hoses from spud pockets prior to removal from the working platform.

## Video

**No video uploaded.**

## Work Performed by Severson

-Continued removal of working platform from the Keuka Lake Outlet.

-Removed spud pockets, power pack, hoses and remaining crane mats from the barges.

-Removed 2 additional floats from the Keuka Lake Outlet.

-Assisted ADMAR with demobilization of historic building investigation equipment.

-Continued to perform site maintenance.

-Continued maintenance of sidewalks and roads, implementing traffic control during delivery of materials.

## Planned Activities

-Begin welding structural sheetpile.

-Complete installation of structural sheeting.

-Begin plantings within the Keuka Lake Outlet prior to June 30th deadline.

## Safety Remarks

-No accidents or incidents were reported.

-Conducted daily safety meeting at 7:00 AM

Safety Topic: Slips, Trips, and Falls

## Work Performed by Subcontractors

-No subcontractors were on-site.

**Remarks/Verbal Directives**

-None.

**Equipment/Materials  
Delivered to Site**

-No equipment or materials  
were delivered to the site.

**Miscellaneous Information**

-None.

## Contractor Equipment List

EQUIPMENT NAME	MAKE/MODEL	MOB DATE	DEMOB DATE
Bulldozer 408E	41 EX Dozer	11/18/15	
Smooth Drum Roller 315E	IR SD-115 D Roller	12/08/15	
Excavator 783E	PC 220	11/23/15	
Excavator 563E	PC300	2/23/16	5/8/17
Excavator 1052-13	PC300 LF	8/24/16	
Air Compressor 808E		2/23/16	
Loader 1124E	Komatsu WA 380	2/25/16	
P218M Barge	Working Platform 50' x40'	4/6/16	
P215M Barge	Working Platform 50' x40'	4/6/16	
P229M Barge	Working Platform 50' x40'	4/6/16	
P259M Barge	Working Platform 50' x40'	4/6/16	
P115O Barge	Working Platform 50' x40'	4/7/16	
1116-92	Winch Power Pack 80hp Poseidon	4/21/16	
1287-92	Hydraulic Spud Winch	4/21/16	
1904E Scow		4/18/16	
996EF Float		4/18/16	
Float		4/18/16	
541E Scow	Single Scow	4/19/16	
540E Scow	Single Scow	4/19/16	
535E JCB		5/16/16	
1037-12 320 Zero Turn		9/19/16	



1313-82 Push Boat	J-Boat Utility	7/21/16
1031-90	Terex RL 4000 Light Plant	9/6/16
970-90	IR Light Plant	9/6/16
1718E	Water Treatment Trailer	8/31/16
1818E	Mixing Tank	8/30/16
1816E	Mixing Tank	8/30/16
1408E	Bag Filter	9/7/16
1714E	Bag Filter	9/7/16
TW1253	Polisher	9/8/16
TW1252	Polisher	9/8/16
838E	Dump Truck	11/2/16
600-13	PC360	1/17/17
205-60E	Dump Truck	11/2/16

### Rental Equipment List

EQUIPMENT NAME	MAKE/MODEL	DESCRIPTION	MOB DATE	QUANTITY	EQUIP #	HOURS
Dumpster	Riccelli	40 CY Rolloff	7/14/15	1		
Porta-Jon's	Larry's Latrines		7/14/15	3		
Office Trailer	Modspace	60' x 12'	3/22/16	1		
Office Trailer	Modspace	44' x 10'	3/23/16	1		
VM Hammer	PVE		4/24/17	1		
60 LB Hammer	Toku TPB60	Breaker	5/10/17	1		
Mini Excavator	Takeuchi	TB228R	5/12/17	1		
Mini Track						

Loader	Toro		5/18/17	1
Electric Core Machine	DP		5/18/17	1
90 LB Hamer	Toku TPB90	Breaker	5/10/17	1

### Labor - Sevenson

# OF PERSONNEL	TYPE OF PERSONNEL	HOURS WORKED
1	Project Engineer	10
1	Project Superintendent	10
4	Operator	40
4	Laborer	40
1	DEC	10
3	AECOM	30

### Labor - Sub Contractors

SUB CONTRACTORS	HOURS WORKED
Woodford Brothers	0
Mertec	0
Thew Associates	0

### Labor Totals

**Today's Sevenson  
Labor Total: 140**

**Today's Contractor  
Labor Total: 0**

**Today's Total  
Labor Hours: 140**

**Total Project Labor  
Hours To Date:  
46440**

### Attachments

**No Attachments  
Uploaded**

**Report Completed By**

First Name

Anthony

Last Name

Laurendi

**Report Date**

June 7, 2017

**Day of the Week**

Wednesday

**Report No.**

334

**Project No.**

P1138

**Weather High**

69°F

**Weather Low**

50°F

**Precipitation**

0.0

**Weather  
Conditions**



Partly  
Cloudy

**Photo 1**



Removing the remaining floats and push boats from the Keuka Lake Outlet.

**Photo 2**



Unloaded spud pocket in laydown yard in preparation for demobilization from the site.



**Photo 3**



Beginning to prep previously installed 22' sheetpile for welding with grinder.

**Photo 4**



Demobilization of JCB 535 and mini excavator from the site.

### **Video**

**No video uploaded.**

### **Work Performed by Severson**

- Removed all Severson equipment from the Keuka Lake Outlet.
- Staged spud pockets, power pack, hoses and remaining crane mats in Severson laydown yard.
- Demobilized JCB 535 and mini excavator from the site.
- Began preparation for welding 22' sheetpile by grinding sheets for weld joints.
- Continued to perform site maintenance.

### **Planned Activities**

- Begin welding structural sheetpile.
- Complete installation of structural sheeting.
- Begin plantings within the Keuka Lake Outlet prior to June 30th deadline.

-Continued maintenance of sidewalks and roads, implementing traffic control during delivery of materials.

### **Safety Remarks**

-No accidents or incidents were reported.  
-Conducted daily safety meeting at 7:00 AM  
Safety Topic:  
Vehicle/Pedestrian Traffic

### **Work Performed by Subcontractors**

-No subcontractors were on-site.

### **Remarks/Verbal Directives**

-None.

### **Equipment/Materials Delivered to Site**

-No equipment or materials were delivered to the site.

### Miscellaneous Information

-None.

### Contractor Equipment List

EQUIPMENT NAME	MAKE/MODEL	MOB DATE	DEMOB DATE
Bulldozer 408E	41 EX Dozer	11/18/15	
Smooth Drum Roller 315E	IR SD-115 D Roller	12/08/15	
Excavator 783E	PC 220	11/23/15	
Excavator 563E	PC300	2/23/16	5/8/17
Excavator 1052-13	PC300 LF	8/24/16	
Air Compressor 808E		2/23/16	
Loader 1124E	Komatsu WA 380	2/25/16	
P218M Barge	Working Platform 50' x40'	4/6/16	
P215M Barge	Working Platform 50' x40'	4/6/16	
P229M Barge	Working Platform 50' x40'	4/6/16	
P259M Barge	Working Platform 50' x40'	4/6/16	
P115O Barge	Working Platform 50' x40'	4/7/16	

1116-92	Winch Power Pack 80hp Poseidon	4/21/16	
1287-92	Hydraulic Spud Winch	4/21/16	
1904E Scow		4/18/16	5/30/16
996EF Float		4/18/16	5/30/16
Float		4/18/16	5/30/16
541E Scow	Single Scow	4/19/16	
540E Scow	Single Scow	4/19/16	
535E JCB		5/16/16	6/7/16
1037-12 320 Zero Turn		9/19/16	
1313-82 Push Boat	J-Boat Utility	7/21/16	
1031-90	Terex RL 4000 Light Plant	9/6/16	
970-90	IR Light Plant	9/6/16	
1718E	Water Treatment Trailer	8/31/16	
1818E	Mixing Tank	8/30/16	
1816E	Mixing Tank	8/30/16	
1408E	Bag Filter	9/7/16	
1714E	Bag Filter	9/7/16	
TW1253	Polisher	9/8/16	
TW1252	Polisher	9/8/16	
600-13	PC360	1/17/17	
205-60E	Dump Truck	11/2/16	

## Rental Equipment List

EQUIPMENT NAME	MAKE/MODEL	DESCRIPTION	MOB DATE	QUANTITY	EQUIP #	HOURS
-------------------	------------	-------------	-------------	----------	------------	-------

Dumpster	Riccelli	40 CY Rolloff	7/14/15	1
Porta-Jon's	Larry's Latrines		7/14/15	3
Office Trailer	Modspace	60' x 12'	3/22/16	1
Office Trailer	Modspace	44' x 10'	3/23/16	1
VM Hammer	PVE		4/24/17	1
Mini Track Loader	Toro		5/18/17	1
Electric Core Machine	DP		5/18/17	1

### Labor - Sevenson

# OF PERSONNEL	TYPE OF PERSONNEL	HOURS WORKED
1	Project Engineer	10
1	Project Superintendent	10
4	Operator	40
4	Laborer	40
1	DEC	10
3	AECOM	30

### Labor - Sub Contractors

SUB CONTRACTORS	HOURS WORKED
Woodford Brothers	0
Mertec	0
Thew Associates	0

### Labor Totals

**Today's Sevenson  
Labor Total: 140**

**Today's Contractor  
Labor Total: 0**

**Today's Total  
Labor Hours: 140**

**Total Project Labor**

Hours To Date:  
46580

### Attachments

No Attachments  
Uploaded

### Report Completed By

First Name

Last Name

Anthony

Laurendi

**Report Date**

June 8, 2017

**Day of the Week**

Thursday

**Report No.**

335

**Project No.**

P1138

**Weather High**

75°F


**Weather Low**

54°F

**Precipitation**

0.0

**Weather  
Conditions**

 Sunny

**Photo 1**



Staged recently removed floats on asphalt pad and cleaning pad with street sweeper.

**Photo 2**



Assisting ADMAR with demobilization of building investigation equipment.



**Photo 3**



Applying poly liner over the excavation area inside the southeast room of the historic structure.

**Photo 4**



Continuing maintenance of the asphalt pad by removing miscellaneous pallets and debris.

### **Video**

**No video uploaded.**

### **Work Performed by Severson**

- Following removal from the outlet, staged floats on asphalt pad.
- Assisted ADMAR in demobilization of building investigation equipment.
- Cleaned and reorganized pad in preparation for demobilization from the site.
- Continued preparation for welding 22' sheetpile by grinding sheets for weld joints.
- Continued to perform site maintenance.

### **Planned Activities**

- Begin welding structural sheetpile.
- Complete installation of structural sheeting.
- Begin plantings within the Keuka Lake Outlet prior to June 30th deadline.

-Continued maintenance of sidewalks and roads, implementing traffic control during delivery of materials.

### **Safety Remarks**

-No accidents or incidents were reported.  
-Conducted daily safety meeting at 7:00 AM  
Safety Topic: PPE/Site Security

### **Work Performed by Subcontractors**

-No subcontractors were on-site.

### **Remarks/Verbal Directives**

-None.

### **Equipment/Materials Delivered to Site**

-No equipment or materials were delivered to the site.

### Miscellaneous Information

-None.

### Contractor Equipment List

EQUIPMENT NAME	MAKE/MODEL	MOB DATE	DEMOB DATE
Bulldozer 408E	41 EX Dozer	11/18/15	
Smooth Drum Roller 315E	IR SD-115 D Roller	12/08/15	
Excavator 783E	PC 220	11/23/15	
Excavator 563E	PC300	2/23/16	5/8/17
Excavator 1052-13	PC300 LF	8/24/16	
Air Compressor 808E		2/23/16	
Loader 1124E	Komatsu WA 380	2/25/16	
P218M Barge	Working Platform 50' x40'	4/6/16	
P215M Barge	Working Platform 50' x40'	4/6/16	
P229M Barge	Working Platform 50' x40'	4/6/16	
P259M Barge	Working Platform 50' x40'	4/6/16	
P115O Barge	Working Platform 50' x40'	4/7/16	

1116-92	Winch Power Pack 80hp Poseidon	4/21/16	
1287-92	Hydraulic Spud Winch	4/21/16	
1904E Scow		4/18/16	5/30/16
996EF Float		4/18/16	5/30/16
Float		4/18/16	5/30/16
541E Scow	Single Scow	4/19/16	
540E Scow	Single Scow	4/19/16	
535E JCB		5/16/16	6/7/16
1037-12 320 Zero Turn		9/19/16	
1313-82 Push Boat	J-Boat Utility	7/21/16	
1031-90	Terex RL 4000 Light Plant	9/6/16	
970-90	IR Light Plant	9/6/16	
1718E	Water Treatment Trailer	8/31/16	
1818E	Mixing Tank	8/30/16	
1816E	Mixing Tank	8/30/16	
1408E	Bag Filter	9/7/16	
1714E	Bag Filter	9/7/16	
TW1253	Polisher	9/8/16	
TW1252	Polisher	9/8/16	
600-13	PC360	1/17/17	
205-60E	Dump Truck	11/2/16	

## Rental Equipment List

EQUIPMENT NAME	MAKE/MODEL	DESCRIPTION	MOB DATE	QUANTITY	EQUIP #	HOURS
-------------------	------------	-------------	-------------	----------	------------	-------

Dumpster	Riccelli	40 CY Rolloff	7/14/15	1
Porta-Jon's	Larry's Latrines		7/14/15	3
Office Trailer	Modspace	60' x 12'	3/22/16	1
Office Trailer	Modspace	44' x 10'	3/23/16	1
VM Hammer	PVE		4/24/17	1
Mini Track Loader	Toro		5/18/17	1
Electric Core Machine	DP		5/18/17	1

### Labor - Sevenson

# OF PERSONNEL	TYPE OF PERSONNEL	HOURS WORKED
1	Project Engineer	10
1	Project Superintendent	10
4	Operator	40
4	Laborer	40
1	DEC	10
3	AECOM	30

### Labor - Sub Contractors

SUB CONTRACTORS	HOURS WORKED
Woodford Brothers	0
Mertec	0
Thew Associates	0

### Labor Totals

**Today's Sevenson  
Labor Total: 140**

**Today's Contractor  
Labor Total: 0**

**Today's Total  
Labor Hours: 140**

**Total Project Labor**

Hours To Date:  
46720

### Attachments

No Attachments  
Uploaded

### Report Completed By

First Name

Last Name

Anthony

Laurendi