


**New York Department of Environmental Conservation
Division of Environmental Remediation
Region 9 Office-Buffalo**

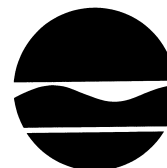

DAILY FIELD REPORT

Date: 8-18-09 to 8-21-09.
Site Name: 3773 Lake Shore Rd. - Snyder Tank
Site Number: -915049 (not listed)
Location: 3773 Lake Shore, Hamburg, NY
DEC Project Engineer: Jaspal S. Walia
Contract Engineer: BenchMark - Brock Greene
Contractor: Zolad - excavator operator

Weather Conditions: Sunny, Temp ~ 85 F

Description of Work Performed: IRM at SB-18

8-19-09: Excavating at SB-18

Removed ~2.5' overburden - mostly asphalt and base to use as refill.

- Directly loaded excavated soils onto dump trucks.
- Excavated soil was trucked to Chaffee Landfill for disposal under Contained -In Criteria.
- Bottom excavation to bedrock .
- Side excavation to the east upto foundation of building; close to storm sewer and edge of Hoover Road towards west. Excavation towards north and south was determined by PID readings. Post excavation samples along the side walls were collected for confirmation. After taking confirmatory samples, excavated area was backfilled.

8-20-09: A 5' x 12' tank was found during excavation. Tank was removed and crushed for disposal.

- Excavation and backfilling almost complete.
- 22 loads were trucked to the Landfill by 2 PM.
- Backfill gravels were trucked from Buffalo Crushed Stone using same trucks.

Problems/Observations Noted: If cleanup objectives are not met in either east or west directions, it would be impossible to extend the excavation further.

- The abandoned tank seems to be the source of contamination at SB-18 area.

HEALTH & SAFETY

PPE: D

Is the PPE in conformance with the specifications? N/A

Are atmospheric monitoring results at acceptable levels? - N/A.

ATTACHMENTS:

Pictures

INSPECTOR'S NAME: Jaspal S. Walia

Distribution: Martin Doster; Cameron O'Connor

