



ENVIRONMENTAL CONSULTATION & REMEDIATION

KPRG and Associates, Inc.

PERIODIC REVIEW REPORT

PERIOD: July 15, 2021 – July 15, 2022
SITE: Prestolite Plant Site, Arcade, New York (#961009)
DATE: August 3, 2022
SUBJECT: Post-Remediation Groundwater Monitoring and General Site Activities

1.0 INTRODUCTION

1.1 Site Summary

Detailed site characterization work was performed for this site from 1991 through 1995 which defined the subsurface geologic and hydrogeologic conditions along with various potential source areas of impact on the subject property.

The groundwater system beneath the site is comprised of two water bearing zones. The upper aquifer is generally under unconfined (water table) conditions. Depth to groundwater generally ranges from eight to ten feet below ground surface (bgs). Groundwater flow beneath the main portion of the Prestolite plant is in a north-northwesterly direction. The lower boundary of the upper aquifer is marked by a tight consistent silt layer of sufficiently low permeability to hydraulically separate the defined upper and lower aquifers. The lower aquifer consists of fine sands, and is confined. The lower boundary is marked by a mappable clay unit. The upper aquifer was determined to be impacted primarily with residual trichloroethene (TCE) and 1,1,1-trichloroethane (1,1,1-TCA). The lower aquifer was determined not to be impacted.

The remedial strategy included a phased approach to addressing each defined source area through a series of voluntary interim remedial measures (IRMs) which included direct removal or treatment. Separate IRM reports were issued for each source area documenting the effectiveness of the action(s) and that the established NYSDEC cleanup criteria were met. The NYSDEC issued a Record of Decision (ROD) in March 2000 which identified the combined IRMs as constituting the final site remedy and that no further remedial action was necessary. The residual groundwater impacts were to be addressed through monitored natural attenuation (MNA). The ongoing monitoring program is

specified in the Site Management Plan (SMP) dated November 11, 2014 for the Prestolite facility.

In March 2009, a sub-slab depressurization system was installed around the administration wing of the facility to address potential vapor intrusion issues. The system has been operating continuously since that time. The operation and maintenance requirements for this system are also included in the SMP. In June 2014, additional sub-slab depressurization systems were installed within a private residence and two commercial structures which are located adjacent to the north side of the Prestolite property. The three addresses are 372 W. Main Street (residence), 364 W. Main Street (Ward & Katzuba Law offices) and 358 W. Main Street (Davis Funeral Home). All three of these systems are operational at this time and as-builts have been submitted to the NYSDEC documenting the effectiveness of each system.

1.2 Effectiveness of Remedial Program

1.2.1 Progress Made During Reporting Period

During the reporting period of July 15, 2021 through July 15, 2022, the following activities were performed/completed at the site:

- Collection of two complete rounds of semi-annual groundwater samples.
- Evaluation of groundwater flow conditions.
- Ongoing operation/maintenance activities.

The results of these activities are discussed in Sections 3.0 and 5.0 below.

1.2.2 Ability to Achieve Remedial Objectives

Based on the monitoring data presented in Section 3.0, the remedial actions that have been performed and the ongoing monitored natural attenuation data indicate that the remedial goals for the Site are being achieved. Groundwater impacts are stable to improving at all locations across the Site (see Section 3.1). The sub-slab venting systems installed for the administration wing of the facility and at three properties located along the north Prestolite property border (a residential property and two commercial properties) were documented to provide sufficient depressurization to mitigate vapor intrusion.

1.3 Compliance

1.3.1 Areas of Non-Compliance

During the reporting period, there were no areas of non-compliance.

1.3.2 Corrective Measures

Not applicable since there were no areas of non-compliance during the reporting period.

1.4 Recommendations

There are no recommended changes to the environmental monitoring program at this time.

2.0 SITE OVERVIEW

2.1 Site Description and Extent of Impacts Prior to Remediation

The Prestolite Leese-Neville facility is located at 400 Main Street in the Village of Arcade, New York. The manufacturing facility is within a commercial and residential area. A site map showing the location of the facility and surrounding land use is provided in Figure 1 in Attachment 1. The site investigation work identified several areas of volatile organic compound (VOC) impacted soils and sludges. In addition, several areas of metals (cadmium, chromium and lead) impacts to soil and sediment were also defined. The areas were:

- Run-off Receiving Area – Cadmium, chromium and lead impacted soils.
- Former Subsurface Weir Structure – Cadmium, chromium, lead, cyanide and VOC impacted sludges.
- Interior Subsurface Vault Structure – VOC impacted soils.
- Beneath Facility Foundation in the Vicinity of Former Degreasers – VOC impacted soils.
- Vicinity of Waste Water Treatment Plant – Cadmium, chromium and lead impacted soils.
- Vicinity of the Former Chemical Storage Building – VOC, cadmium, chromium and lead impacted soils.
- Cemetery Creek – Cadmium, chromium and lead impacted sediments.
- Beneath Facility Foundation in Vicinity of Administration Wing – VOC soil vapor.
- Beneath Foundations of a Residence and Two Commercial Structures North of the Prestolite Plant – Potential VOC soil vapor.

A map showing the locations of these areas is provided in Figure 2 in Attachment 1. Groundwater was documented to be primarily impacted with TCE, 1,1,1-TCA, cadmium, chromium and lead. Groundwater flow is in a north-northwesterly direction. The lateral extent of groundwater impacts was defined to reach the northwest property boundary. Additional off-site characterization determined that the minor impacts that have migrated past the site boundary have mixed with VOC impacts from other potential sources in the area. The vertical extent of impacts was determined to be limited to the upper aquifer as described in Section 1.1. The NYSDEC did not require further groundwater characterization.

2.2 General Chronology of Remediation Program

Between 1991 and 1999, various IRMs were implemented for the defined source areas of environmental impacts. The following IRMs were successfully completed, in the order provided, from first to most recent.

- Metals impacted soil removal from the Run-off Receiving Area for proper off-site disposal.
- Removal of VOC and metals impacted sediments for proper off-site disposal from a former subsurface weir structure located beneath the north parking lot. The structure was then cleaned and decommissioned.
- Removal of VOC impacted soils from within a former subsurface vault beneath northwest portion of the manufacturing building for proper off-site disposal.
- Remediation of VOC impacted subsurface soils beneath the manufacturing building in the vicinity of two former degreasers using soil vapor extraction (SVE). The system was in operation for approximately 5 years, after which time verification soil samples were collected and determined that established cleanup objectives were met. The SVE system was decommissioned in 1999.
- Remediation of metals impacted soils in the vicinity of the waste water treatment building using on-site stabilization and capping.
- Remediation of VOC and metals impacted soils in the vicinity of the former chemical storage building using in-situ, thermally enhanced VOC stripping followed by metals stabilization and capping.
- Metals impacted sediment removal from Cemetery Creek for proper off-site disposal.

- Installation of a sub-slab depressurization system for the administration wing of the facility.
- Installation of sub-slab depressurization systems for a residence and two commercial structures located to the north of the Prestolite facility.

Separate IRM reports were issued for each source area remediation documenting the effectiveness of the action(s) and that the established NYSDEC cleanup criteria were met. The NYSDEC issued a Record of Decision (ROD) in March, 2000 which identified the combined IRMs as constituting the final site remedy and that no further remedial action was necessary. The only exception was the installation of the sub-slab depressurization system around the administration wing of the facility which was installed in 2009. Documentation of the installation was provided to the NYSDEC and subsequently approved as complete. The site is currently in groundwater monitoring mode to monitor the effectiveness of the various IRMs and track ongoing natural attenuation progress. A soil vapor intrusion study was performed and resulted in the installation of sub-slab depressurization systems beneath the administration wing of the plant (noted above), two off-site commercial buildings and an off-site residence. The NYSDEC approved completion of the soil vapor study aspects for the site in a memo dated May 15, 2015.

3.0 EVALUATION OF REMEDY PERFORMANCE, EFFECTIVENESS and PROTECTIVENESS

3.1 Semi-Annual Groundwater Monitoring Results

Groundwater samples were collected in November 2021 and June 2022 from wells MW-01, MW-01DA, MW-02A, MW-03, MW-05, MW-06A, MW-06DA, MW-07, MW-09, MW-09D, MW-11, MW-12, MW-13 and MW-14. The analytical results from the groundwater monitoring were used to gauge the effectiveness of remedial measures completed at the site.

Analytical data for the semi-annual events are summarized for VOCs and inorganics, respectively, in Tables 1 and 2 in Attachment 2. A summary of all previously collected groundwater data is also presented in these tables for comparison purposes. Sample locations are provided on Figure 2 in Attachment 1. The field sampling and analytical laboratory data packages are provided in Attachment 3. Plots of concentration versus time for representative VOCs detected at well locations are provided in Attachment 4.

A review of the VOC data in Table 1 and the time versus concentration plots in Attachment 4 indicates steady to decreasing trends in VOC concentrations at all well locations. It is noted that at this point there are consistently no detections of 1,1,1-TCA in groundwater at any of the well locations. The only detections of

TCE above the 5 ug/l groundwater standard are at wells MW-01, MW-06A, MW-09 and MW-12, with the highest concentration from the June 2022 sampling event being from well MW-06A with a TCE concentration of 18 ug/l.

A review of metals data in Table 2 indicates that for the last two rounds of sampling, there were low level detections of total lead and/or chromium at several well locations (MW-05, MW-06DA, MW-09, MW-09D and MW-14). However, the dissolved metals analyses at these locations showed no detections of metals indicating that the detections were associated with the suspended sediment load within the sample and were not mobile within the groundwater system.

Based on the above-presented groundwater monitoring data, the source mitigation/control remedial actions performed at this site have been effective and groundwater quality conditions generally continue to improve with ongoing natural attenuation.

3.2 Evaluation of Groundwater Flow Conditions

The groundwater levels collected during the two semi-annual sampling events are provided with the data packages in Attachment 3. The water levels were used to generate updated groundwater elevation contour maps which are provided as Figures 3 and 4 in Attachment 1. A review of the figures indicates that the flow conditions are consistent with historic patterns for the site with a northerly to northwesterly groundwater flow beneath the facility. Based on this observation, the existing groundwater monitoring well network is sufficient for ongoing monitoring.

4.0 IC/EC PLAN COMPLIANCE REPORT

4.1 IC/EC Requirements and Compliance

The following Institutional Control (IC) and Engineering Controls (ECs) are in place at this site:

- IC – A groundwater use restriction has been placed for this site.
- ECs – Monitoring wells, cover system and vapor mitigation systems.

The IC and ECs are discussed separately below.

4.1.1 Groundwater Use Restriction

To preclude potential future use of groundwater beneath the site, a groundwater use restriction was placed on the property deed. The restriction is on file at the Wyoming County Registrar of Deeds. No

groundwater wells have been installed at the site with the exception of the environmental monitoring wells.

4.1.2 Monitoring Wells

The environmental monitoring program approved for the site consists of semi-annual groundwater sampling of existing monitoring wells MW-01, MW-01DA, MW-02A, MW-03, MW-05, MW-06A, MW-06DA, MW-07, MW-09, MW-09D, MW-11, MW-12, MW-13 and MW-14. These wells are inspected for integrity concurrently with each sampling event (see Section 6.1).

4.1.3 Soil Cover and Drainage Control

Since metals impacted soils in the vicinity of the waste water treatment plant and former chemical storage building were treated via stabilization and remain in-situ, a soil cover was placed over the treated soils to prevent potential direct contact exposure and preclude erosional runoff into the adjoining Cemetery Creek. In addition, a drainage swale was constructed uphill of the area to direct surface runoff to the west, around the cover area to further assist in erosion control and minimize infiltration.

The soil cover, drainage swale and the adjoining banks of Cemetery Creek are inspected regularly as part of ongoing operation and maintenance (O&M) activities. To date, the ECs installed have been functioning as designed. Historically only minor cover repairs have been required. The controls continue to function effectively and as designed.

Routine semi-annual inspections of the drainage control and cover system are completed by Prestolite plant personnel (See Sections 6.2 and 6.3).

4.1.4 Vapor Mitigation

Sub-slab depressurization systems (SSDSs) were installed as part of vapor mitigation requirements beneath the administrative wing of the Prestolite facility at 400 Main Street and three private properties to the north with addresses of 372, 364 and 358 Main Street. The 372 Main Street property includes a private residence and the other two properties are former residences converted to commercial use including legal offices and a funeral home, respectively. Routine inspection of the Prestolite plant system is completed by plant personnel on a monthly basis and annually by the installation contractor. The off-site SSDS installations are inspected on an annual basis by the installation contractor (See Section 6.4).

4.2 IC/EC Certification

The required annual IC/EC Certification is provided in Attachment 5.

5.0 MONITORING PLAN COMPLIANCE REPORT

The environmental monitoring program approved for the site consists of semi-annual groundwater sampling of existing monitoring wells MW-01, MW-01DA, MW-02A, MW-03, MW-05, MW-06A, MW-06DA, MW-07, MW-09, MW-09D, MW-11, MW-12, MW-13 and MW-14. All samples collected are analyzed for VOCs and total/dissolved cadmium, chromium and lead. The results of the most recent monitoring along with all historical monitoring data and associated conclusions/recommendations are provided in Section 3.0. The facility is in compliance with monitoring requirements and there are no deficiencies.

6.0 OPERATION AND MAINTENANCE PLAN COMPLIANCE

The following four O&M activities are currently being performed:

- Inspection and maintenance of monitoring wells.
- Inspection of Cemetery Creek along the length of the subject property to evaluate potential evidence of bank/sidewall erosion into the stabilized soil mass.
- Inspection and maintenance of soil cover and upgradient drainage swale.
- Inspection of sub-slab depressurization systems.

The results of each inspection are discussed separately below.

6.1 Monitoring Well Inspection and Maintenance

As part of groundwater sampling activities, the integrity of each monitoring well was inspected. Discussions with the sampling contractor indicate that the wells (concrete aprons and protectors) were found to be in good condition during both rounds of semi-annual sampling with the exceptions that the curb box for flush mount well MW-13 was found in poor condition and the concrete apron at well MW-14 was also noted to be loose, probably from frost heave during the winter, but otherwise in good condition. These items will be addressed as part of well maintenance in the second half of 2022.

6.2 Cemetery Creek Inspection

Mr. James Bodensteiner of Prestolite performed the required inspections of Cemetery Creek. Copies of the inspection forms are provided in Attachment 6. The inspections indicated three-quarters channel flow during the December 2021 inspection and one-quarter channel flow during the June 2022 inspection. During both inspections, there was no indication of accumulated debris causing blockage. The channel walls/banks were in good condition.

6.3 Soil Cover and Drainage Swale Inspection

The required soil erosion prevention inspections were also performed by Mr. James Bodensteiner. Copies of the inspection forms are included in Attachment 6. The inspection found all aspects of the soil cover and drainage swale to be in good condition. No rill development issues were identified along the banks.

The upgradient drainage swale was in good condition. No other substantive inspection comments were provided.

6.4 Sub-slab Depressurization System Inspection

Monthly inspections of the sub-slab depressurization system were performed by Prestolite contractor, Day Environmental. Copies of the inspection forms are provided in Attachment 6. The entire system was found to be in good operating condition throughout the reporting period. In addition, Certified Radon Systems (CRS; system installer) completed a check of the system installed at the Prestolite facility which was also found in good operating condition. The manometer readings collected by CRS are also included in Attachment 6.

On October 4, 2021, an annual sub-slab depressurization system check was also made of the systems installed at one residence and two commercial properties located at 372, 364 and 358 Main Street, respectively. The inspections were completed by CRS which was the contractor that installed the systems. The systems were found in good operational condition. The manometer readings collected on October 4th are provided in Attachment 6 as well as a table of any changes in manometer readings from the previous year.

7.0 OVERALL CONCLUSIONS AND RECOMMENDATIONS

Based on the data and information presented in this Periodic Progress Report, the following conclusions and recommendations are forwarded:

- All aspects of the current monitoring program and associated site ICs and ECs are in compliance.
- There are no recommended changes to the ICs or ECs.
- The monitoring data presented in this report documents that the remedial strategy implemented for this site has met performance standards and continues to be effective as indicated by the stable to improving MNA groundwater conditions. No changes to the monitoring program are recommended at this time.

- Progress reports are presently being submitted on an annual basis. No change in submittal frequency is proposed at this time.

ATTACHMENT 1
Figures



0 300'
APPROXIMATE SCALE

ENVIRONMENTAL CONSULTATION & REMEDIATION

K P R G

KPRG and Associates, Inc.

14665 West Lisbon Road, Suite 2B Brookfield, Wisconsin 53005 Telephone 262-781-0475 Facsimile 262-781-0478

414 Plaza Drive, Suite 106 Westmont, Illinois 60559 Telephone 630-325-1300 Facsimile 630-325-1593

SITE AREA MAP


Prestolite Leece - Neville Site
Arcade, New York

Scale: 1" = 300' | Date: July 14, 2016

KPRG Project No. 21803.8

FIGURE 1

w:\Projects\Motorola\Arcade 2022\2022 annual report gw maps.dwg

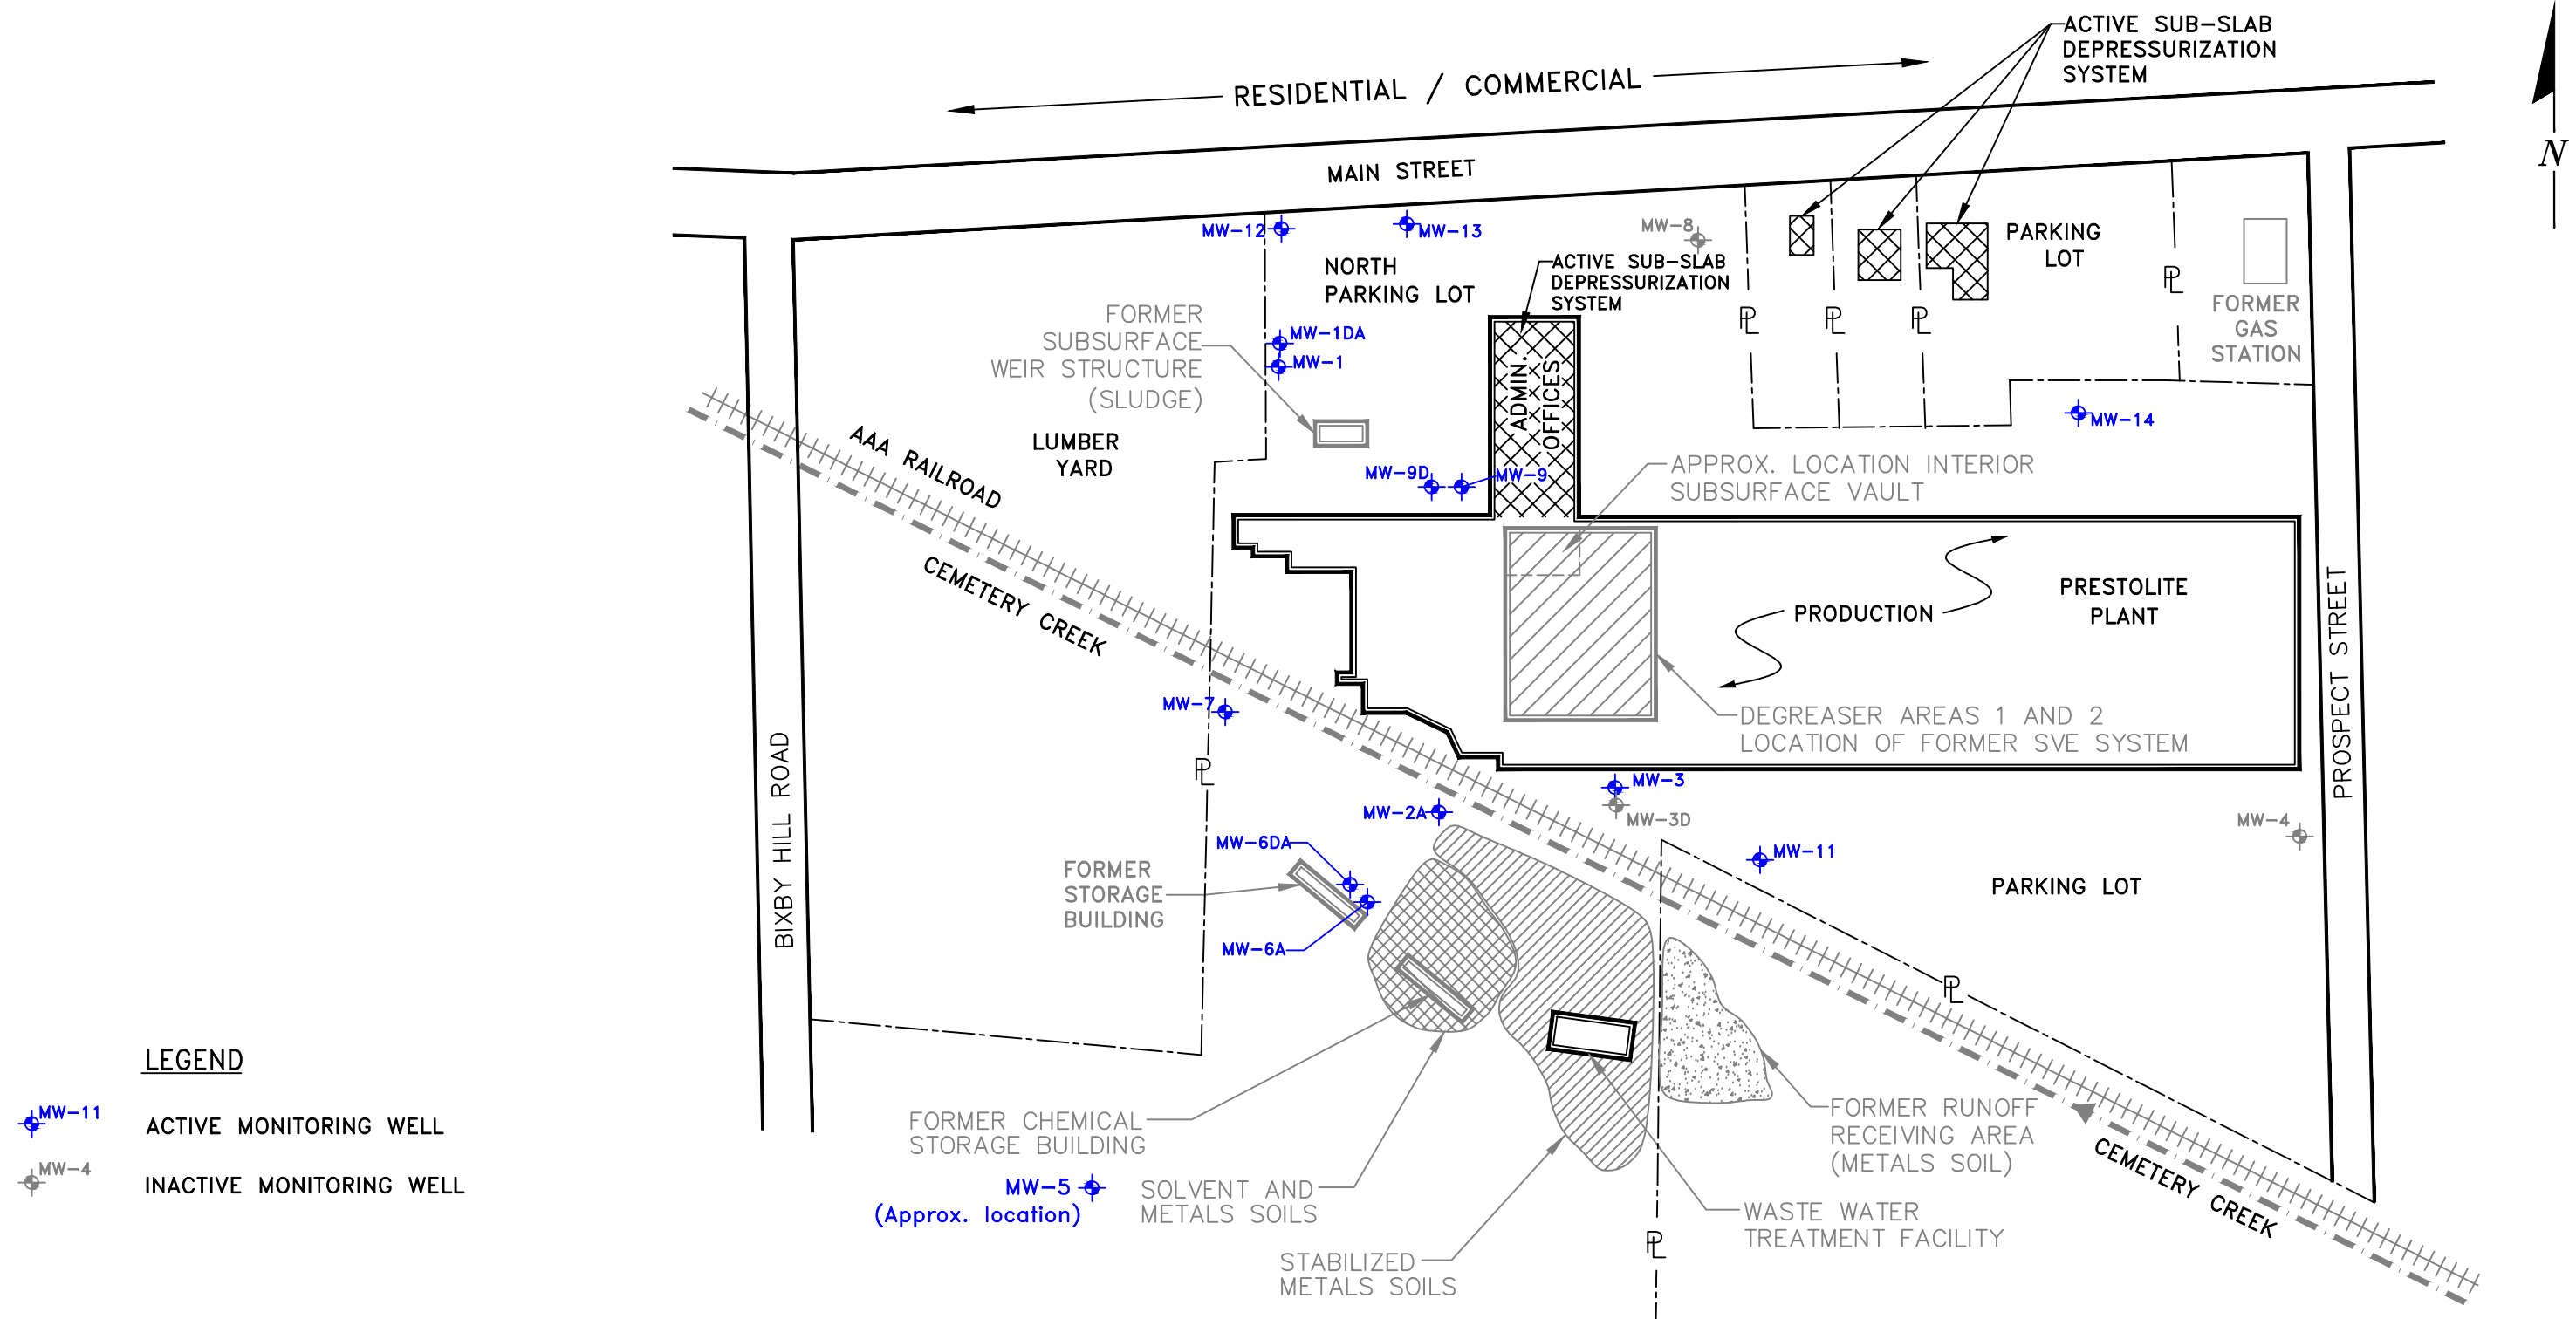

ENVIRONMENTAL CONSULTATION & REMEDIATION

K P R G

KPRG and Associates, inc.

14665 West Lisbon Road, Suite 1A Brookfield, Wisconsin 53005 Telephone 262-781-0475 Facsimile 262-781-0478

414 Plaza Drive, Suite 106 Westmont, Illinois 60559 Telephone 630-325-1300 Facsimile 630-325-1593

GROUNDWATER MONITORING WELL LOCATIONS

Motorola, Inc., Presolite Plant
Arcade, New York

Scale: 1" = 200'

Date: August 2, 2022

KPRG Project No. 21803.18


FIGURE 2

All locations and dimensions are approximate.

GROUNDWATER ELEVATIONS (ft msl)	
MW-1	1464.60
MW-2A	1470.14
MW-3	1468.59
MW-5	1562.14
MW-6A	1470.08
MW-7	1472.37
MW-9	1466.72
MW-11	1468.80
MW-12	1463.94
MW-13	1464.06
MW-14	1466.65

LEGEND

-  MW-11
- ACTIVE MONITORING WELL
-  MW-4
- INACTIVE MONITORING WELL
-  1468
- GROUNDWATER CONTOUR
- 
- FLOWLINE

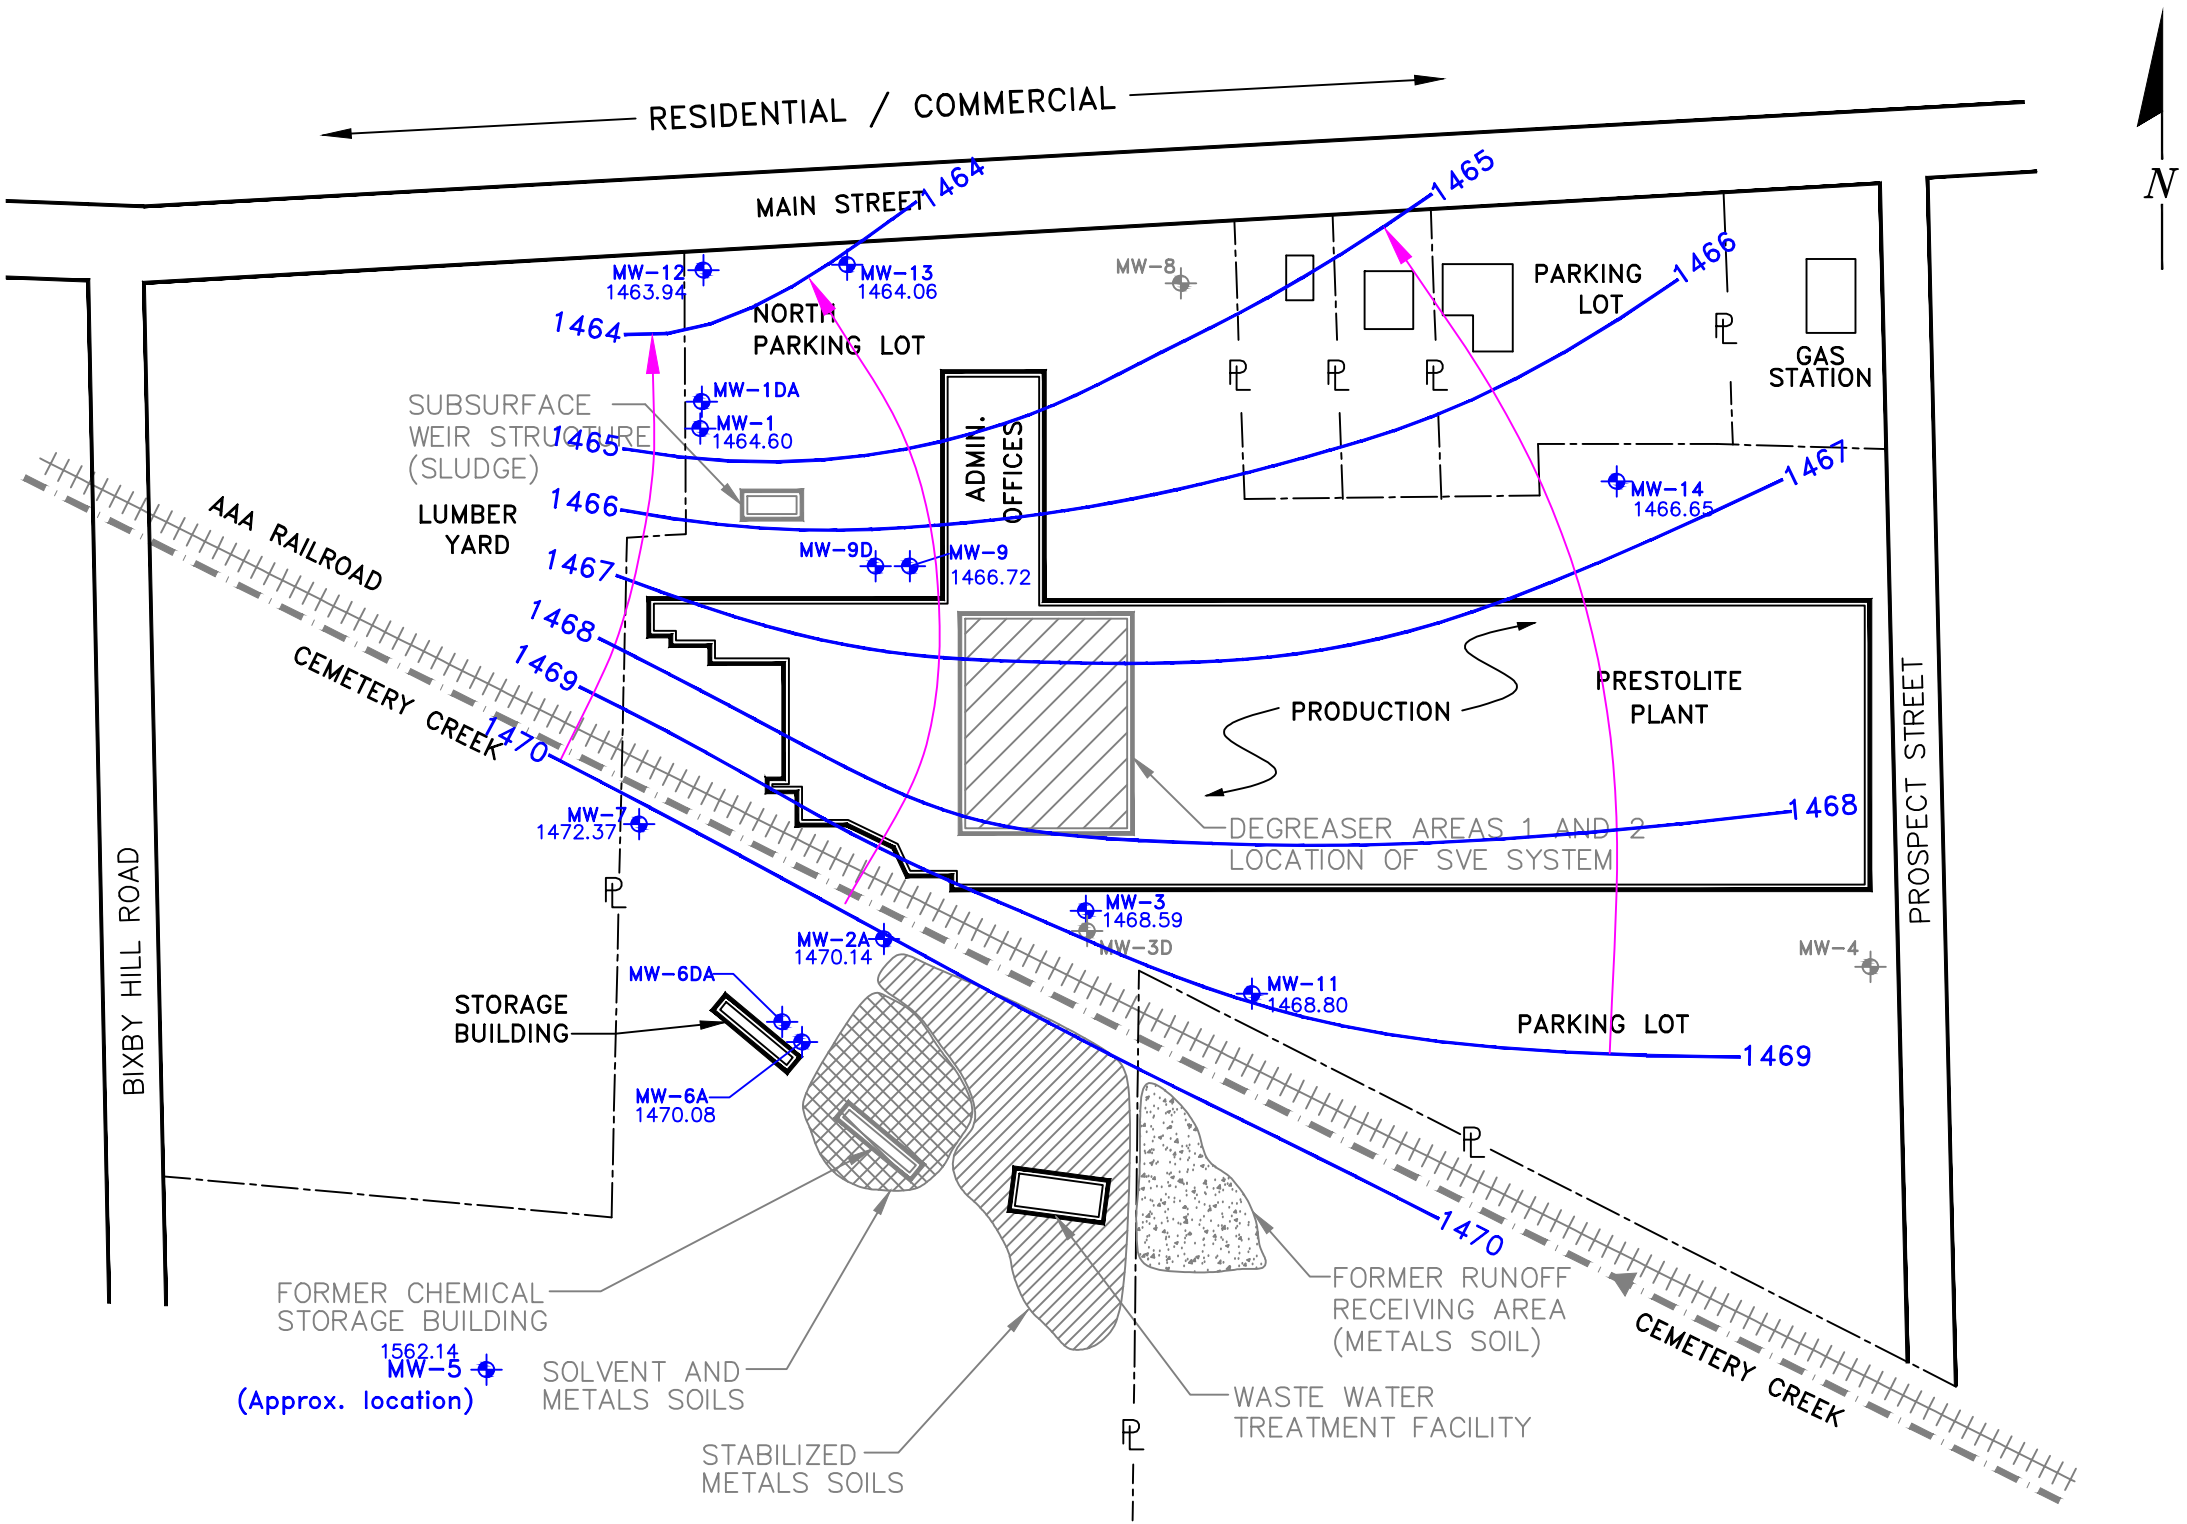

0 200'
APPROXIMATE SCALE

ENVIRONMENTAL CONSULTATION & REMEDIATION

K P R G

KPRG and Associates, inc.

14665 West Lisbon Road, Suite 1A Brookfield, Wisconsin 53005 Telephone 262-781-0475 Facsimile 262-781-0478

414 Plaza Drive, Suite 106 Westmont, Illinois 60559 Telephone 630-325-1300 Facsimile 630-325-1593

All locations and dimensions are approximate.

GROUNDWATER CONTOUR MAP 11/2021

Motorola, Inc., Presolite Plant
Arcade, New York

Scale: 1" = 200'

Date: July 26, 2022


KPRG Project No. 21803.18

FIGURE 3

GROUNDWATER ELEVATIONS (ft msl)	
MW-1	1464.34
MW-2A	1468.79
MW-3	1467.95
MW-5	1530.64
MW-6A	1469.02
MW-7	1468.99
MW-9	1466.43
MW-11	1468.20
MW-12	1463.64
MW-13	1463.76
MW-14	1466.28

LEGEND

-  MW-11 ACTIVE MONITORING WELL
-  MW-4 INACTIVE MONITORING WELL
-  1468 GROUNDWATER CONTOUR
-  FLOWLINE

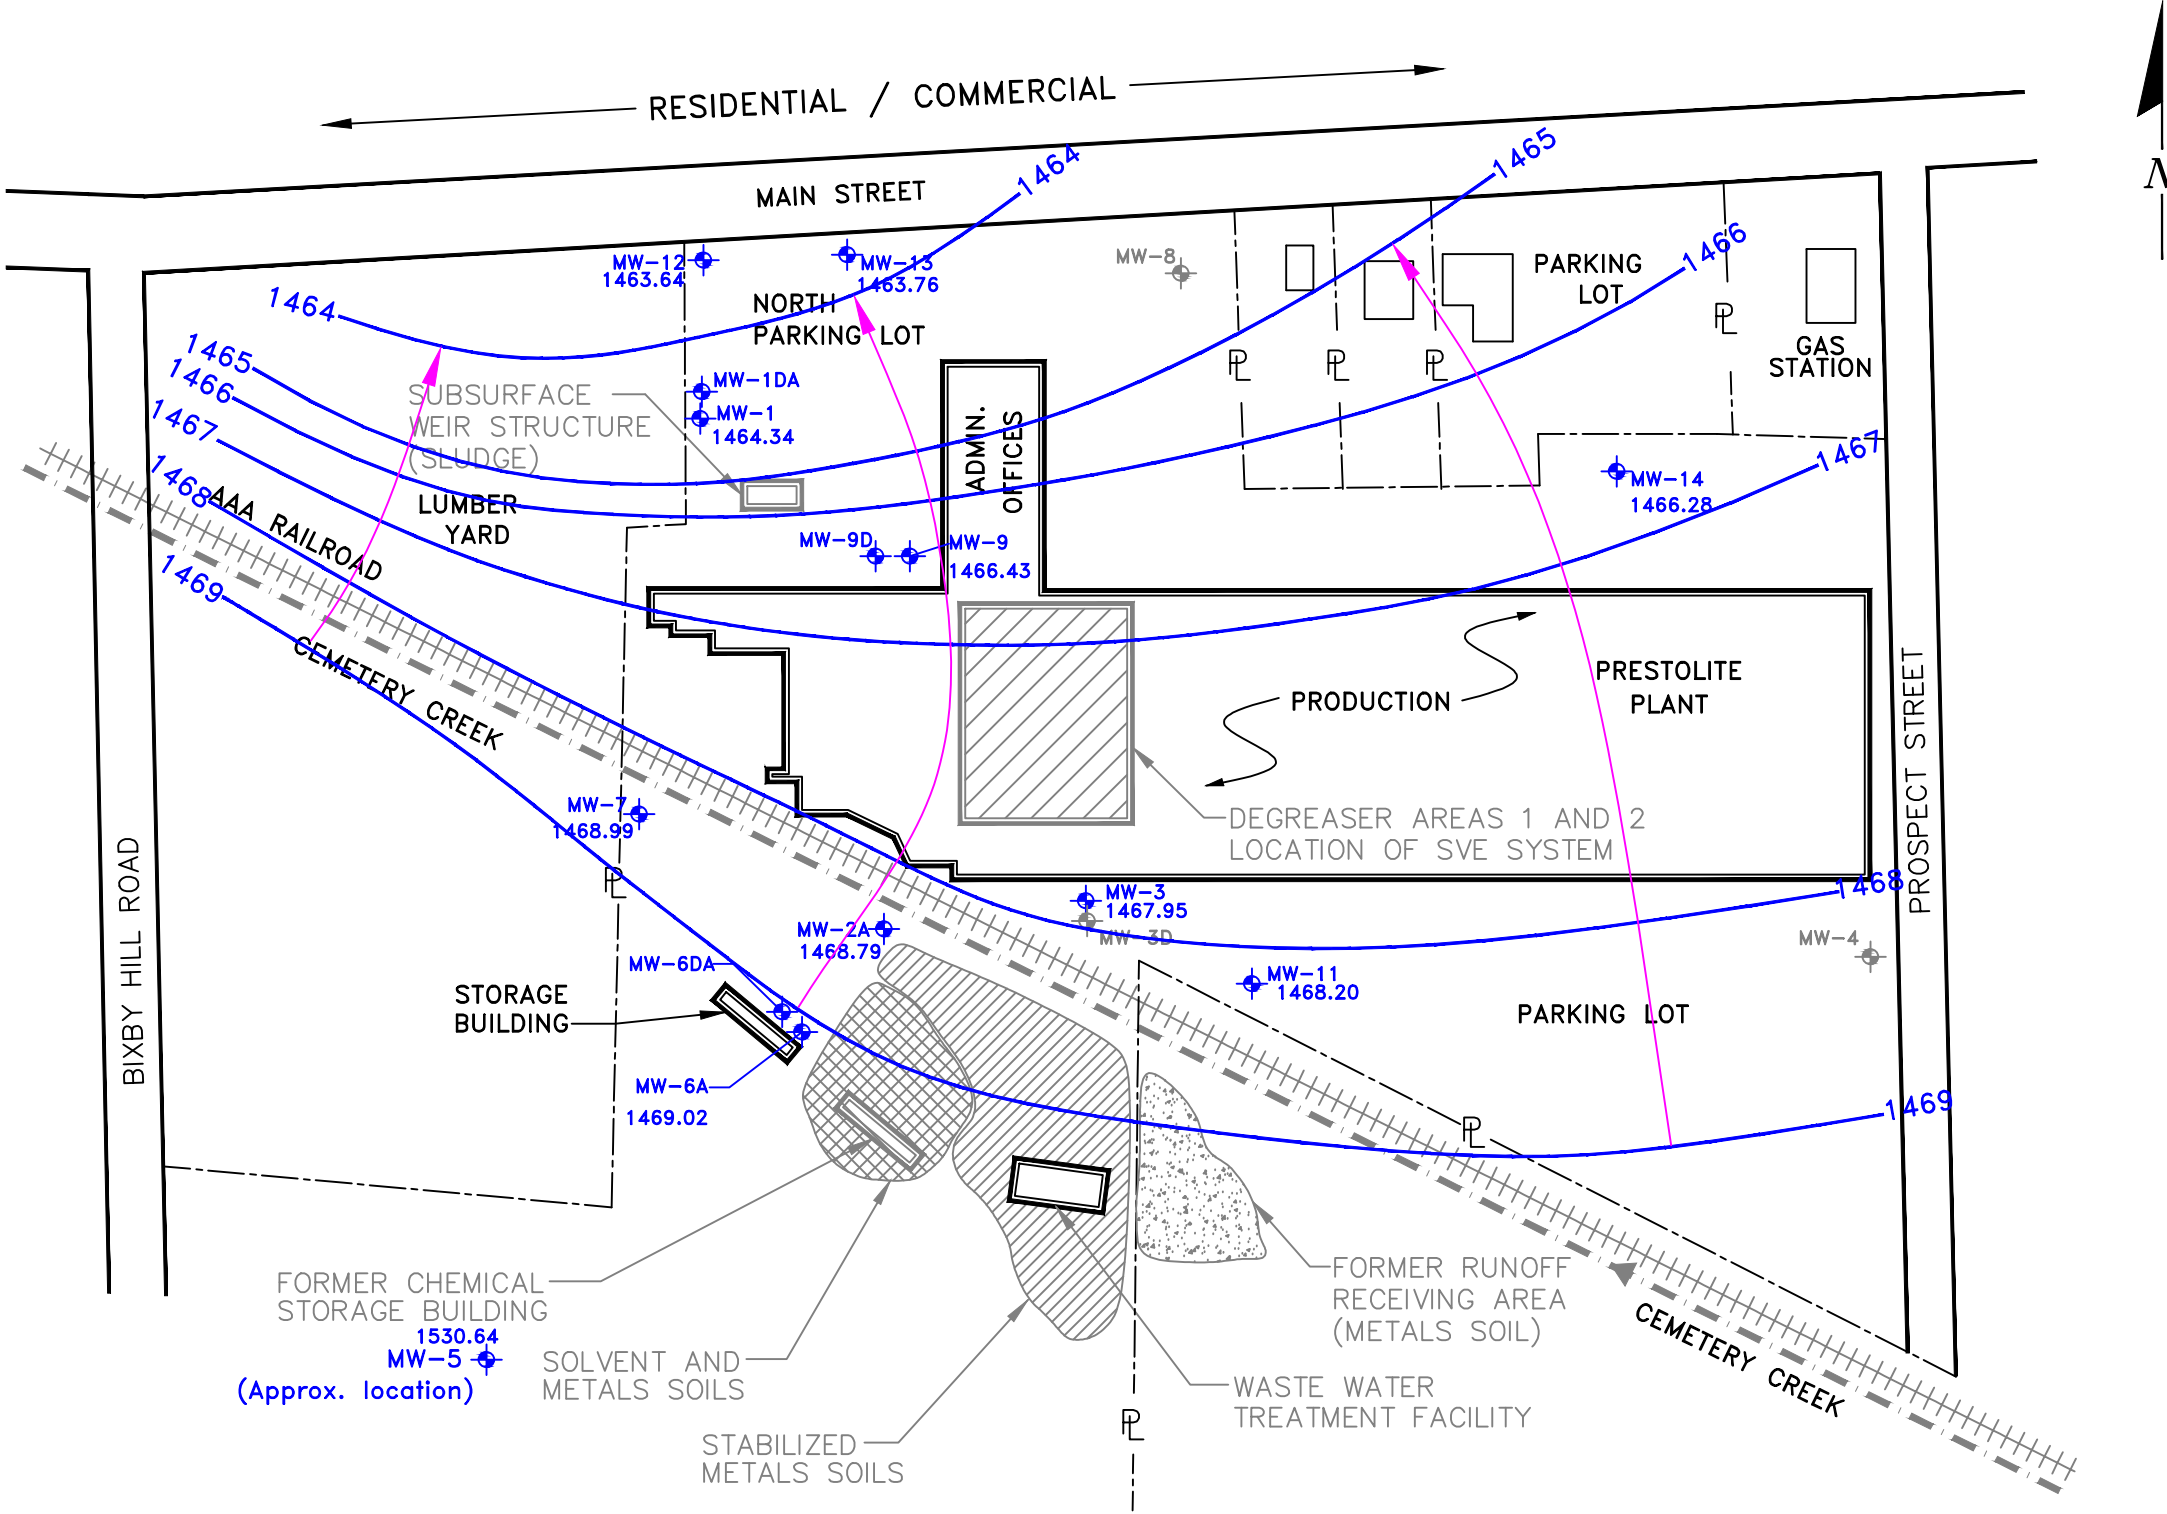

0 200'
APPROXIMATE SCALE

ENVIRONMENTAL CONSULTATION & REMEDIATION

K P R G

KPRG and Associates, inc.

14665 West Lisbon Road, Suite 1A Brookfield, Wisconsin 53005 Telephone 262-781-0475 Facsimile 262-781-0478

414 Plaza Drive, Suite 106 Westmont, Illinois 60559 Telephone 630-325-1300 Facsimile 630-325-1593

GROUNDWATER CONTOUR MAP 6/2022

Motorola, Inc., Presolite Plant
Arcade, New York

Scale: 1" = 200' Date: July 26, 2022

KPRG Project No. 21803.18 FIGURE 4

All locations and dimensions are approximate.

ATTACHMENT 2
Tables

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethane	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled	2/92	--	--	--	--	120	17	--	--	--	--	--
		10/92	--	--	--	--	130	19	--	--	--	--	--
MW-01 (Relocated 12/99)	6/93	--	--	--	--	--	100	12	--	--	--	--	--
	11/93	(0.9) BJ	--	--	--	--	110 B	12	--	--	--	--	--
	5/94	--	--	--	--	--	98	9	--	--	--	--	--
	1/95	--	--	--	--	--	76	7 J	--	--	--	--	--
	6/95	--	--	--	--	--	90	7 J	--	--	--	--	--
	9/95	--	--	--	--	--	110	8J	--	--	--	--	--
	11/95	--	--	--	--	--	140	9J	--	--	--	--	--
	3/96	--	--	--	--	--	96	5J	--	--	--	--	--
	6/96	--	--	--	--	--	100	6J	--	--	--	--	--
	9/96	--	--	--	--	--	98	7J	--	--	--	--	--
	12/96	--	--	--	--	--	91	7J	--	--	--	--	--
	2/97	--	--	--	--	--	79	5J	--	--	--	--	--
	4/97	--	--	--	--	--	70	4J	--	--	--	--	--
	7/97	--	--	--	--	--	88	6J	--	--	--	--	--
	10/97	--	--	--	--	--	90	6J	--	--	--	--	--
	1/98	--	--	--	--	--	78	4J	--	--	--	--	--
	8/98	--	--	--	--	--	84	5J	--	--	--	--	--
	1/99	--	--	--	--	--	54	4J	--	--	--	--	--
	7/99	--	--	--	--	--	55	4J	--	--	--	--	--
	12/99	--	--	--	--	--	67	4.6	0.49J	--	--	--	--
	1/00	--	--	--	--	23	35	2J	--	--	--	--	--
	8/00	--	--	--	--	3J	38	2J	--	--	--	--	--
	1/01	--	--	--	--	--	40	3 J	--	--	--	--	--
	8/01	2BJ	--	--	--	--	40	3 J	--	--	--	--	--
	1/02	--	--	--	--	--	37	2J	--	--	--	--	--
	8/02	1BJ	--	--	3BJ	2BJ	37	2J	--	--	--	--	--
	1/03	--	--	--	--	--	25	2J	--	--	--	--	--
	7/03	--	--	--	--	--	34	2J	--	--	--	--	--
	1/04	--	--	--	--	--	21	--	--	--	--	--	--
	8/04	--	--	--	--	--	35	2J	--	--	--	--	--
	1/05	--	--	--	--	--	21	--	--	--	--	--	--
	7/05	--	--	--	--	--	27	2J	--	--	--	2BJ	9BJ
	1/06	--	--	--	--	--	24	2J	--	--	--	--	--
	8/06	--	--	--	--	1J	27	2J	--	--	--	--	--
	1/07	--	--	--	--	--	22	1J	--	--	--	--	--
	7/07	--	--	--	--	--	23	1J	--	--	--	--	--
	1/08	--	--	--	--	--	20	1J	--	--	--	--	--
	7/08	--	--	--	--	--	24	1J	--	--	--	--	--
	1/09	--	--	--	--	--	19	--	--	--	--	--	--
	7/09	--	--	--	--	--	23	1J	--	--	--	--	--
	2/10	--	--	--	--	--	17	0.84J	--	--	--	--	--
	8/10	--	--	--	--	--	21	--	--	--	--	--	--
	1/11	--	--	--	--	--	16	--	--	--	--	--	--
	8/11	--	--	--	--	--	23	--	--	--	--	--	--
	1/12	--	--	--	--	--	15	--	--	--	--	--	--
	8/12	--	--	--	--	--	20	--	--	--	--	--	--
	1/13	--	--	--	--	--	16	--	--	--	--	--	--
	8/13	--	--	--	--	--	18	--	--	--	--	--	--
	1/14	--	--	--	--	--	13	--	--	--	--	--	--
	8/14	--	--	--	--	--	17	--	--	--	--	--	--
1/15	--	--	--	--	--	14	--	--	--	--	--	--	
7/15	--	--	--	--	--	13	--	--	--	--	--	--	
1/16	--	--	--	--	--	12	--	--	--	--	--	--	
7/16	--	--	--	--	--	15	--	--	--	--	--	--	
1/17	--	--	--	--	--	11	--	--	--	--	--	--	
7/17	--	--	--	--	--	13	--	--	--	--	--	--	
1/18	--	--	--	--	--	12	--	--	--	--	--	--	
8/18	--	--	--	--	--	14	--	--	--	--	--	--	
6/19	--	--	--	--	--	8.1 J	--	--	--	--	--	--	
11/19	--	--	--	--	--	9.5 J	--	--	--	--	--	--	
6/20	--	--	--	--	3.5 J	10	--	--	--	--	--	--	
12/20	--	--	--	--	--	13	--	--	--	--	--	--	
4/21	--	--	--	--	--	11	--	--	--	--	--	--	
11/21	--	--	--	--	--	14	--	--	--	--	--	--	
6/22	--	--	--	--	--	11	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled												
MW-01DA	1/95	--	--	--	110	--	--	--	--	--	--	--	--
	6/95	--	--	--	120	--	--	--	--	--	--	--	--
	9/95	--	--	--	--	--	--	--	--	--	--	--	--
	11/95	--	--	--	--	--	--	--	--	--	--	--	--
	3/96	--	--	--	76	--	--	--	--	--	--	--	--
	6/96	--	--	--	8J	--	--	--	--	--	--	--	--
	9/96	--	--	--	--	--	--	--	--	--	--	--	--
	12/96	--	--	--	--	--	--	--	--	--	--	--	--
	2/97	--	--	--	--	--	--	--	--	--	--	--	--
	4/97	--	--	--	--	--	--	--	--	--	--	--	--
	7/97	--	--	--	--	--	--	--	--	--	--	--	--
	10/97	--	--	--	--	--	--	--	--	--	--	--	--
	1/98	--	--	--	--	--	--	--	--	--	--	--	--
	8/98	--	--	--	--	--	--	--	--	--	--	--	--
	1/99	--	--	--	--	--	--	--	--	--	--	--	--
	7/99	--	--	--	--	--	--	--	--	--	--	--	--
	12/99	--	--	--	--	--	--	--	--	--	--	--	--
	1/00	--	--	--	4J	--	--	--	--	--	--	--	--
	8/00	--	--	--	--	--	--	--	--	--	--	--	--
	1/01	--	--	--	--	--	--	--	--	--	--	--	--
	8/01	--	--	--	--	--	--	--	--	--	--	--	--
	1/02	--	--	--	--	--	--	--	--	--	--	--	--
	8/02	--	--	4BJ	3BJ	--	--	--	--	--	--	--	--
	1/03	--	--	--	--	--	--	--	--	--	--	--	--
	7/03	--	--	--	--	--	--	--	--	--	--	--	--
	1/04	--	--	--	--	--	--	--	--	--	--	--	--
	8/04	--	--	--	--	--	--	--	--	--	--	--	--
	1/05	--	--	--	--	--	--	--	--	--	--	--	--
	7/05	--	--	--	--	--	--	--	--	--	--	6BJ	--
	1/06	--	--	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	--	--	--	--	--	--	--	--
	1/07	--	--	--	--	--	--	--	--	--	--	--	--
	7/07	--	--	--	--	--	--	--	--	--	--	--	--
	1/08	--	--	--	--	--	--	--	--	--	--	--	--
	7/08	--	--	--	--	--	--	--	--	--	--	--	--
	1/09	--	--	--	--	--	--	--	--	--	--	--	--
	2/10	--	--	--	--	--	--	--	--	--	--	--	--
	8/10	--	--	--	--	--	--	--	--	--	--	--	--
	1/11	--	--	--	--	--	--	--	--	--	--	--	--
	8/11	--	--	--	--	--	--	--	--	--	--	--	--
	1/12	--	--	--	--	--	--	--	--	--	--	--	--
	8/12	--	--	--	--	--	--	--	--	--	--	--	--
1/13	--	--	--	--	--	--	--	--	--	--	--	--	
8/13	--	--	--	--	--	--	--	--	--	--	--	--	
1/14	--	--	--	--	--	--	--	--	--	--	--	--	
8/14	--	--	--	--	--	--	--	--	--	--	--	--	
1/15	--	--	--	--	--	--	--	--	--	--	--	--	
7/15	--	--	--	--	--	--	--	--	--	--	--	--	
1/16	--	--	--	--	--	--	--	--	--	--	--	--	
7/16	--	--	--	--	--	--	--	--	--	--	--	--	
1/17	--	--	--	--	--	--	--	--	--	--	--	--	
7/17	--	--	--	--	--	--	--	--	--	--	--	--	
1/18	--	--	--	--	--	--	--	--	--	--	--	--	
8/18	--	--	--	--	--	--	--	--	--	--	--	--	
6/19	--	--	--	--	--	--	--	--	--	--	--	--	
11/19	--	--	--	--	--	--	--	--	--	--	--	--	
6/20	--	--	--	--	--	--	--	--	--	--	--	--	
12/20	--	--	--	--	--	--	--	--	--	--	--	--	
4/21	--	--	--	--	--	--	--	--	--	--	--	--	
11/21	--	--	--	--	--	--	--	--	--	--	--	--	
6/22	--	--	--	--	--	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L													
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethane	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone		
MW-02A	Well Number	Date Sampled	1/95	7 J	--	--	16	17	2 J	24	--	10	41	93	--
	6/95	180 D	2 J	--	--	66	14	--	62	1 J	67	160	850	--	--
	9/95	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	11/95	--	--	--	--	--	3 J	--	--	--	--	--	--	--	--
	3/96	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	6/96	22	--	--	--	4J	--	--	28	--	4J	36	220	--	--
	9/96	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	12/96	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	2/97	--	--	--	--	--	--	--	6J	--	1J	--	1J	--	--
	4/97	3J	--	--	--	--	--	--	10	--	5J	4J	51	--	--
	7/97	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	10/97	8J	NS	NS	NS	7J	NS	NS	20	NS	6J	12	95	NS	NS
	1/98	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/98	20B	--	--	--	30	3J	--	16	--	2J	51	320	--	--
	1/99	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	7/99	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/00	18	NS	NS	NS	110	2J	NS	17	NS	5J	24	180	NS	NS
	1/01	1J	--	--	--	--	--	--	2J	--	--	--	8J	--	--
	1/02	3J	--	--	--	13	1J	--	7J	--	1J	--	33	2J	--
	1/03	6J	--	--	--	--	2J	--	6J	--	--	15	84	--	--
	7/03	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/04	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/04	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/05	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	7/05	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/06	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	--	2J	--	--	--	--	--	--	--	--
	1/07	3J	--	--	--	2J	2J	--	4J	--	1J	6J	41	--	--
	7/07	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/08	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	7/08	--	--	--	--	--	--	--	2J	--	--	1J	--	--	--
	1/09	--	--	--	--	--	1.3J	--	--	--	--	--	--	--	--
	7/09	--	--	--	--	1.9J	1.5J	--	1.8J	--	--	0.99J	14	--	--
	2/10	--	--	--	--	--	2.3J	--	--	--	--	--	--	--	--
	8/10	--	--	--	--	2.8J	--	--	2.2J	--	--	20	100	--	--
	1/11	--	--	--	--	--	2.4J	--	--	--	--	--	--	--	--
	8/11	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/12	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/12	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/13	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/13	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/14	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/14	--	--	--	--	2.7J	--	--	--	--	--	--	--	--	--
	1/15	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	7/15	--	--	--	--	--	--	--	2.1J	--	--	--	--	--	--
	1/16	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	7/16	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/17	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	7/17	--	--	--	--	--	0.87J	--	1.2J	--	--	--	--	--	--
	1/18	--	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/18	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	6/19	--	--	--	--	--	1.8J	--	--	--	--	--	--	--	--
	11/19	--	--	--	--	--	0.93 J	--	--	--	--	--	--	--	--
	6/20	--	--	--	--	--	1.6 J	--	2.3 J	--	--	--	--	--	--
	12/20	--	--	--	--	--	1.4 J	--	--	--	--	--	--	--	--
	4/21	--	--	--	--	--	1.5 J	--	--	--	--	--	--	--	--
	11/21	--	--	--	--	--	1.9 J	--	--	--	--	--	--	--	--
	6/22	--	--	--	--	3.7J	1.9J	--	2.9J	--	--	--	--	--	--

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethane	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
MW-03	Well Number	Date Sampled											
		2/92	--	--	--	--	22	6	--	--	--	--	--
		10/92	--	--	--	--	25	7 J	5 J	--	--	--	--
		6/93	--	--	--	--	19	4 J	2 J	--	--	--	--
		11/93	(0.6) BJ	--	--	--	13 B	2 J	--	--	--	--	--
		5/94	--	--	--	--	27	7	1 J	--	--	--	--
		1/95	--	--	--	--	20	--	1 J	--	--	--	--
		6/95	--	--	--	--	12	2 J	7 J	--	--	--	--
		9/95	--	--	--	--	4 J	--	1 J	--	--	--	--
		11/95	--	--	--	--	6 J	--	3 J	--	--	--	--
		3/96	--	--	--	--	10	--	--	--	--	--	--
		6/96	--	--	--	--	29	5J	2J	--	--	--	--
		9/96	--	--	--	--	3J	--	1J	--	--	--	--
		12/96	--	--	--	--	6J	--	7J	--	--	--	--
		2/97	--	--	--	--	7J	--	7J	--	--	--	--
		4/97	--	--	--	--	--	--	3J	--	--	--	--
		7/97	--	--	--	--	3J	--	2J	--	--	--	--
		10/97	--	--	--	--	5J	--	3J	--	--	--	--
		1/98	--	--	--	--	9J	1J	--	--	--	--	--
		8/98	--	--	--	--	6J	--	--	--	--	1J	--
		1/99	--	--	--	--	6J	--	--	--	--	--	--
		7/99	--	--	--	--	--	--	--	--	--	--	--
		1/00	--	4J	--	--	2J	--	2J	--	1J	--	--
		8/00	--	2J	--	--	--	--	2J	--	--	--	--
		1/01	--	1J	--	--	--	--	1J	1J	--	--	--
		8/01	--	2BJ	--	--	--	--	1J	--	--	--	--
		1/02	--	--	--	--	--	--	--	--	--	--	--
		8/02	2BJ	--	4BJ	3BJ	2J	--	--	--	--	--	--
		1/03	--	--	--	--	2J	--	--	--	--	--	--
		7/03	--	--	--	--	2J	--	--	--	--	--	--
		1/04	--	--	--	--	2J	--	--	--	--	--	--
		8/04	--	--	--	--	3J	--	--	--	--	--	--
		1/05	--	--	--	--	2J	--	--	--	--	--	--
		7/05	--	--	--	--	2J	--	--	--	--	--	--
		1/06	--	--	--	--	--	--	--	1J	--	--	--
		8/06	--	--	--	--	--	--	--	--	--	--	--
		1/07	--	--	--	--	--	--	--	--	--	--	--
		7/07	--	--	--	--	--	--	--	--	--	--	--
		1/08	--	--	--	--	--	--	--	--	--	--	--
		7/08	--	--	--	--	1J	--	2J	--	1J	--	--
		1/09	--	--	--	--	--	--	1.8J	--	--	--	--
		7/09	--	--	--	--	0.77J	--	1.6J	--	1J	--	--
		2/10	--	--	--	--	--	--	1.5J	--	1.0J	--	--
		8/10	--	--	--	--	--	--	3.8J	--	--	--	--
		1/11	--	--	--	--	--	--	--	--	--	--	--
		8/11	--	--	--	--	--	--	2.9J	--	--	--	--
	1/12	--	--	--	--	--	--	--	--	--	--	--	
	8/12	--	--	--	--	--	--	--	--	--	--	--	
	1/13	--	--	--	--	--	--	--	--	--	--	--	
	8/13	--	--	--	--	--	--	2.5J	--	--	--	--	
	1/14	--	--	--	--	--	--	--	--	--	--	--	
	8/14	--	--	--	--	--	--	2.8J	--	--	--	--	
	1/15	--	--	--	--	--	--	--	--	--	--	--	
	7/15	--	--	--	--	--	--	--	--	--	--	--	
	1/16	--	--	--	--	--	--	--	--	--	--	--	
	7/16	--	--	--	--	--	--	--	--	--	--	--	
	1/17	--	--	--	--	--	--	--	--	--	--	--	
	7/17	--	--	--	--	0.78J	--	1.4J	--	--	--	--	
	1/18	--	--	--	--	--	--	--	--	--	--	--	
	8/18	--	--	--	--	0.78J	--	2.3J	--	--	--	--	
	6/19	--	--	--	--	--	--	1.2J	--	--	--	--	
	11/19	--	--	--	--	--	--	--	--	--	--	--	
	6/20	--	--	--	--	0.46 J	--	--	--	--	--	--	
	12/20	--	--	--	--	0.70 J	--	--	--	--	--	--	
	4/21	--	--	--	--	0.73 J	--	--	--	--	--	--	
	11/21	--	--	--	--	0.51 J	--	--	--	--	--	--	
	6/22	--	--	--	--	0.76J	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethane	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
MW-05	Well Number	Date Sampled	--	--	--	10	--	--	--	--	--	--	--
		10/92	--	--	--	(12)	--	--	--	--	--	--	--
		6/93	--	--	--	--	--	--	--	--	--	--	--
		11/93	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
		5/94	--	--	--	--	--	--	--	--	--	--	--
		1/95	--	--	--	--	--	--	--	--	--	--	--
		6/95	--	--	--	--	--	--	--	--	--	--	--
		9/95	--	--	--	--	--	--	--	--	--	--	--
		11/95	--	--	--	--	--	--	--	--	--	--	--
		3/96	--	--	--	--	--	--	--	--	--	--	--
		6/96	--	--	--	--	--	--	--	--	--	--	--
		9/96	--	--	--	--	--	--	--	--	--	--	--
		12/96	--	--	--	--	--	--	--	--	--	--	--
		2/97	--	--	--	--	--	--	--	--	--	--	--
		4/97	--	--	--	--	--	--	--	--	--	--	--
		7/97	--	--	--	--	--	--	--	--	--	--	--
		10/97	--	--	--	4J	--	--	--	--	--	--	--
		1/98	--	--	--	--	--	--	--	--	--	--	--
		8/98	--	--	--	--	--	--	--	--	--	--	--
		1/99	--	--	--	--	--	--	--	--	--	--	--
		7/99	--	--	--	--	--	--	--	--	--	--	--
		1/00	--	--	--	--	--	--	--	--	--	--	--
		8/00	--	--	--	--	--	--	--	--	--	--	--
		1/01	--	--	--	--	--	--	--	--	--	--	--
		8/01	1BJ	--	--	--	--	--	--	--	--	--	--
		1/02	--	--	--	--	--	--	--	--	--	--	--
		8/02	1BJ	--	3BJ	2BJ	--	--	--	2--	--	--	--
		1/03	--	--	--	--	--	--	--	--	--	--	--
		7/03	--	--	--	--	--	--	--	--	--	--	--
		1/04	--	--	--	--	--	--	--	--	--	--	--
		8/04	--	--	--	--	--	--	--	--	--	--	--
		1/05	--	--	--	--	--	--	--	--	--	--	--
		7/05	--	--	--	--	--	--	--	--	--	--	--
		1/06	--	--	--	--	--	--	--	--	--	--	--
		8/06	--	--	--	--	--	--	--	--	--	--	--
		1/07	--	--	--	--	--	--	--	--	--	--	--
		7/07	--	--	--	--	--	--	--	--	--	--	--
		1/08	--	--	--	--	--	--	--	--	--	--	--
		1/09	--	--	--	--	--	--	--	--	--	--	--
		7/09	--	--	--	--	--	--	--	--	--	--	--
		2/10	--	--	--	--	--	--	--	--	--	--	--
		8/10	--	--	--	11	--	--	--	--	--	--	--
		1/11	--	--	--	--	--	--	--	--	--	--	--
		8/11	--	--	--	--	--	--	--	--	--	--	--
		1/12	--	--	--	--	--	--	--	--	--	--	--
	8/12	--	--	--	--	--	--	--	--	--	--	--	
	1/13	--	--	--	--	--	--	--	--	--	--	--	
	8/13	--	--	--	--	--	--	--	--	--	--	--	
	1/14	--	--	--	--	--	--	--	--	--	--	--	
	8/14	--	--	--	--	--	--	--	--	--	--	--	
	1/15	--	--	--	--	--	--	--	--	--	--	--	
	7/15	--	--	--	--	--	--	--	--	--	--	--	
	1/16	--	--	--	--	--	--	--	--	--	--	--	
	7/16	--	--	--	--	--	--	--	--	--	--	--	
	1/17	--	--	--	--	--	--	--	--	--	--	--	
	7/17	--	--	--	--	--	--	--	--	--	--	--	
	1/18	--	--	--	--	--	--	--	--	--	--	--	
	8/18	--	--	--	3.9J	--	--	--	--	--	--	--	
	6/19	--	--	--	--	--	--	--	--	--	--	--	
	11/19	--	--	--	--	--	--	--	--	--	--	--	
	6/20	--	--	--	--	--	--	--	--	--	--	--	
	12/20	--	--	--	--	--	--	--	--	--	--	--	
	4/21	--	--	--	--	--	--	--	--	--	--	--	
	11/21	--	--	--	3.2 J	--	--	--	--	--	--	--	
	6/22	--	--	--	--	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethane	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled												
MW-06A	1/95	--	--	--	170	59	--	2 J	--	--	--	--	--
	6/95	--	--	--	--	54	--	--	--	--	--	--	--
	9/95	--	--	--	--	61	--	1 J	--	--	--	--	--
	11/95	--	--	--	--	43	--	--	--	--	--	--	--
	3/96	--	--	--	--	40	--	--	--	--	--	--	--
	6/96	--	--	--	--	52	--	1 J	--	--	--	--	--
	9/96	--	--	--	--	52	--	--	--	--	--	--	--
	12/96	--	--	--	--	43	--	1J	--	--	--	--	--
	2/97	--	--	2BJ	--	47	--	--	--	--	--	--	--
	4/97	--	--	--	--	29	--	--	--	--	--	--	--
	7/97	--	--	--	--	40	--	1J	--	--	--	--	--
	10/97	--	--	--	--	50	--	1J	--	--	--	--	--
	1/98	--	--	--	--	13	--	--	--	--	--	--	--
	8/98	--	--	--	--	50	--	--	--	--	--	--	--
	1/99	--	--	--	--	51	--	1J	--	--	--	--	--
	7/99	--	--	--	--	42	--	1J	--	--	--	--	--
	1/00	--	4J	--	--	2J	--	2J	--	1J	--	--	--
	8/00	--	--	--	--	38	--	1J	--	--	--	--	--
	1/01	--	--	--	--	40	--	2J	--	--	--	--	--
	8/01	1BJ	--	--	--	40	--	1J	--	--	--	--	--
	1/02	--	--	--	--	43	--	2J	--	--	--	--	--
	8/02	2BJ	--	4BJ	4BJ	13	--	--	--	--	--	--	--
	1/03	--	--	--	--	36	--	--	--	--	--	--	--
	7/03	--	--	--	--	35	--	--	--	--	--	--	--
	1/04	--	--	--	--	--	--	--	--	--	--	--	--
	8/04	--	--	--	--	36	--	--	--	--	--	--	--
	1/05	--	--	--	--	29	--	--	--	--	--	--	--
	7/05	--	--	--	--	30	--	--	--	--	--	--	--
	1/06	--	--	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	27	--	--	--	--	--	--	--
	1/07	--	--	--	--	21	--	--	--	--	--	--	--
	7/07	--	--	--	--	22	--	--	--	--	--	--	--
	1/08	--	--	--	--	15	--	--	--	--	--	--	--
	7/08	--	--	--	--	27	--	1J	--	--	--	--	--
	1/09	--	--	--	--	29	--	--	--	--	--	--	--
	7/09	--	--	--	--	27	--	1J	--	--	--	--	--
	2/10	--	--	--	--	27	--	0.92J	--	--	--	--	--
	8/10	--	--	--	--	25	--	1.4J	--	--	--	--	--
	1/11	--	--	--	--	27	--	--	--	--	--	--	--
	8/11	--	--	--	--	19	--	--	--	--	--	--	--
	1/12	--	--	--	--	11	--	--	--	--	--	--	--
	8/12	--	--	--	--	28	--	--	--	--	--	--	--
1/13	--	--	--	--	27	--	--	--	--	--	--	--	
8/13	--	--	--	--	22	--	--	--	--	--	--	--	
1/14	--	--	--	--	22	--	--	--	--	--	--	--	
8/14	--	--	--	--	21	--	--	--	--	--	--	--	
1/15	--	--	--	--	27	--	--	--	--	--	--	--	
7/15	--	--	--	--	22	--	--	--	--	--	--	--	
1/16	--	--	--	--	23	--	--	--	--	--	--	--	
7/16	--	--	--	--	23	--	--	--	--	--	--	--	
1/17	--	--	--	--	--	--	--	--	--	--	--	--	
7/17	--	--	--	--	20	--	0.85J	--	--	--	--	--	
1/18	--	--	--	--	24	--	0.91J	--	--	--	--	--	
8/18	--	--	--	--	22	--	1.0J	--	--	--	--	--	
6/19	--	--	--	--	--	--	--	--	--	--	--	--	
11/19	--	--	--	--	19	--	--	--	--	--	--	--	
6/20	--	--	--	--	-- F1	--	--	--	--	--	--	--	
12/20	--	--	--	--	19	--	--	--	--	--	--	--	
4/21	--	--	--	--	18	--	--	--	--	--	--	--	
11/21	--	--	--	--	20	--	--	--	--	--	--	--	
6/22	--	--	--	--	18	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

			Parameters ug/L													
			Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone		
MW-06DA	Well Number	Date Sampled	--	--	--	440	--	--	--	--	--	--	--	--	--	--
		1/95	--	--	--	95	--	--	--	--	--	--	--	--	--	--
		6/95	--	--	--	42	--	--	--	--	--	--	--	--	--	--
		9/95	--	--	--	15	--	--	--	--	--	--	--	--	--	--
		11/95	--	--	--	20	--	--	--	--	--	--	--	--	--	--
		3/96	--	--	--	130	--	--	--	--	--	--	--	--	--	44
		6/96	--	--	--	71	--	--	--	--	--	--	--	--	--	--
		9/96	--	--	--	30	--	--	--	--	--	--	--	--	--	8
		12/96	--	--	2BJ	50	--	--	--	--	--	--	--	--	--	8
		2/97	--	--	--	89	--	--	--	--	--	--	--	--	--	--
		4/97	--	--	--	52	--	--	--	--	--	--	--	--	--	9
		7/97	--	--	--	30	--	--	--	--	--	--	--	--	--	--
		10/97	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		1/98	--	--	--	38	--	--	--	--	--	--	--	--	--	--
		8/98	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		1/99	--	--	--	26	--	--	--	--	--	--	--	--	--	--
		7/99	--	--	--	19	--	--	--	--	--	--	--	--	--	--
		1/00	--	--	--	6J	--	--	--	--	--	--	--	--	--	--
		8/00	--	--	--	13	--	--	--	--	--	--	--	--	--	--
		1/01	1BJ	--	--	6J	--	--	--	--	--	--	--	--	--	--
		8/01	--	--	--	4J	--	--	--	--	--	--	--	--	--	--
		1/02	--	--	4BJ	4BJ	--	--	--	--	--	--	--	--	--	--
		8/02	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		1/03	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		7/03	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		1/04	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		8/04	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		1/05	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		7/05	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		1/06	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		8/06	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		1/07	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		7/07	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		1/08	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		7/08	--	--	--	--	--	--	1J	--	--	--	--	--	--	--
		1/09	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		7/09	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		2/10	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		8/10	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		1/11	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		8/11	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		1/12	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		8/12	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		1/13	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		8/13	--	--	--	--	--	--	--	--	--	--	--	--	--	--
		1/14	--	--	--	3.2 J	--	--	--	--	--	--	--	--	--	--
	8/14	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
	1/15	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
	7/15	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
	1/16	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
	7/16	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
	1/17	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
	7/17	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
	1/18	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
	8/18	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
	6/19	--	--	--	--	13	--	--	--	--	--	--	--	--	--	
	11/19	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
	6/20	--	--	--	--	18	--	0.86 J	--	--	--	--	--	--	--	
	12/20	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
	4/21	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
	11/21	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
	6/22	--	--	--	--	--	--	--	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled												
MW-07	2/92	--	--	3 BJ	--	--	--	--	--	--	--	--	--
	10/92	--	--	--	--	--	--	--	--	--	--	--	--
	6/93	--	--	--	--	--	--	--	--	--	--	--	--
	11/93	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	5/94	--	--	--	--	2 J	--	--	--	--	--	--	--
	1/95	--	--	--	--	--	--	--	--	--	--	--	--
	6/95	--	--	--	--	--	--	--	--	--	--	--	--
	9/95	--	--	--	--	--	--	--	--	--	--	--	--
	11/95	--	--	--	--	--	--	--	--	--	--	--	--
	3/96	--	--	--	--	--	--	--	--	--	--	--	--
	6/96	--	--	--	--	--	--	--	--	--	--	--	--
	9/96	--	--	--	--	--	--	--	--	--	--	--	--
	12/96	--	--	--	--	--	--	--	--	--	--	--	--
	2/97	--	--	--	--	--	--	--	--	--	--	--	--
	4/97	--	--	--	--	--	--	--	--	--	--	--	--
	7/97	--	--	--	--	--	--	--	--	--	--	--	--
	10/97	--	--	--	--	--	--	--	--	--	--	--	--
	1/98	--	--	--	--	--	--	--	--	--	--	--	--
	8/98	2BJ	--	--	--	--	--	--	--	--	--	--	--
	1/99	--	--	--	--	--	--	--	--	--	--	--	--
	7/99	--	--	--	--	--	--	--	--	--	--	--	--
	1/00	--	--	--	--	--	--	--	--	--	--	--	--
	8/00	--	--	--	--	--	--	--	--	--	--	--	--
	1/01	--	--	--	--	--	--	--	--	--	--	--	--
	8/01	1BJ	--	--	--	--	--	--	--	--	--	--	--
	1/02	--	--	--	--	1J	--	--	--	--	--	--	--
	8/02	--	--	5BJ	2BJ	--	--	--	--	--	--	--	--
	1/03	--	--	--	--	--	--	--	--	--	--	--	--
	7/03	--	--	--	--	--	--	--	--	--	--	--	--
	1/04	--	--	--	--	--	--	--	--	--	--	--	--
	8/04	--	--	--	--	--	--	--	--	--	--	--	--
	1/05	--	--	--	--	--	--	--	--	--	--	--	--
	7/05	--	--	--	--	--	--	--	--	--	--	--	--
	1/06	--	--	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	--	--	--	--	--	--	--	--
	1/07	--	--	--	--	--	--	--	--	--	--	--	--
	7/07	--	--	--	--	--	--	--	--	--	--	--	--
	1/08	--	--	--	--	--	--	--	--	--	--	--	--
	7/08	--	--	--	--	--	--	--	--	--	--	--	--
	1/09	--	--	--	--	--	--	--	--	--	--	--	--
	7/09	--	--	--	--	--	--	--	--	--	--	--	--
	2/10	--	--	--	--	--	--	--	--	--	--	--	--
	8/10	--	--	--	--	--	--	--	--	--	--	--	--
	1/11	--	--	--	--	--	--	--	--	--	--	--	--
	8/11	--	--	--	--	--	--	--	--	--	--	--	--
	1/12	--	--	--	--	--	--	--	--	--	--	--	--
8/12	--	--	--	--	--	--	--	--	--	--	--	--	
1/13	--	--	--	3.1J	--	--	--	--	--	--	--	1.5J	
8/13	--	--	--	--	--	--	--	--	--	--	--	--	
1/14	--	--	--	--	--	--	--	--	--	--	--	--	
8/14	--	--	--	--	--	--	--	--	--	--	--	--	
1/15	--	--	--	--	--	--	--	--	--	--	--	--	
7/15	--	--	--	--	--	--	--	--	--	--	--	--	
1/16	--	--	--	--	--	--	--	--	--	--	--	--	
7/16	--	--	--	--	--	--	--	--	--	--	--	--	
1/17	--	--	--	--	--	--	--	--	--	--	--	--	
7/17	--	--	--	--	--	--	--	--	--	--	--	--	
1/18	--	--	--	--	--	--	--	--	--	--	--	--	
8/18	--	--	--	4.3J	--	--	--	--	--	--	--	--	
6/19	--	--	--	--	--	--	--	--	--	--	--	--	
11/19	--	--	--	--	--	--	--	--	--	--	--	--	
6/20	--	--	--	--	--	--	--	--	--	--	--	--	
12/20	--	--	--	--	--	--	--	--	--	--	--	--	
4/21	--	--	--	--	--	--	--	--	--	--	--	--	
11/21	--	--	--	--	--	--	--	--	--	--	--	--	
6/22	--	--	--	--	--	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled	2/92	--	--	--	--	89	14	11	--	--	--	--
		10/92	--	--	--	--	92	11	3 J	--	--	--	--
MW-09	6/93	--	--	--	--	--	78	10	3 J	--	--	--	--
	11/93	--	--	--	--	--	87 B	8	--	--	--	--	--
	5/94	--	--	--	--	--	93	6	8	--	--	--	--
	1/95	--	--	--	--	--	61	4 J	22	--	--	--	--
	6/95	--	--	--	--	--	13,000	5 J	15	--	--	--	--
	9/95	--	--	--	--	--	4,100	--	--	--	--	--	--
	11/95	42 J	--	--	--	--	2,900	--	--	--	--	--	--
	3/96	--	--	--	--	--	550	9 J	29	--	--	--	--
	6/96	--	--	--	--	--	600	4 J	30	--	--	--	--
	9/96	--	--	--	--	--	350	--	9J	--	--	--	--
	12/96	--	--	--	--	--	190D	3J	5J	--	--	--	--
	2/97	--	--	--	--	--	190	2J	5J	--	--	--	--
	4/97	--	--	--	--	--	150	2J	2J	--	--	--	--
	7/97	--	--	--	--	--	370	2J	4J	--	--	--	--
	10/97	--	--	--	--	--	120	3J	4J	2J	3J	--	--
	1/98	--	--	--	--	--	170	--	2J	--	--	--	--
	8/98	1BJ	--	--	--	--	83	2J	4J	--	--	--	--
	1/99	--	--	--	--	--	32	1J	--	5J	6J	--	--
	7/99	--	--	--	--	--	20	--	6J	6J	1J	--	--
	1/00	--	--	--	--	--	34	--	5J	6J	2J	--	--
	8/00	--	--	--	--	--	32	1J	3J	--	--	--	--
	1/01	--	--	--	--	--	33	--	5J	2J	--	--	--
	8/01	1BJ	--	--	--	--	23	1J	5J	5J	2J	--	--
	1/02	--	--	--	--	--	20	--	4J	7J	1J	--	--
	8/02	2BJ	--	4BJ	3BJ	--	18	--	6J	4J	3J	--	--
	1/03	--	--	--	--	--	20	--	--	4J	--	--	--
	7/03	--	--	--	--	--	12	--	5J	4J	3J	--	--
	1/04	--	--	--	--	--	25	--	--	2J	--	--	--
	8/04	--	--	--	--	--	11	--	--	4J	--	--	--
	1/05	--	--	--	--	--	17	--	--	2J	--	--	--
	7/05	--	--	--	--	--	7J	--	--	6J	4J	--	--
	1/06	--	--	--	--	--	18	--	--	3J	--	--	--
	8/06	--	--	--	--	--	14	--	3J	3J	--	--	--
	1/07	--	--	--	--	--	20	--	2J	1J	--	--	--
	7/07	--	--	--	--	--	9J	--	3J	4J	4J	--	--
	1/08	--	--	--	--	--	20	--	2J	--	--	--	--
	7/08	--	--	--	--	--	9J	--	3J	2J	1J	--	--
	1/09	--	--	--	--	--	15	--	2.0J	1.1J	--	--	--
	7/09	--	--	--	--	--	12	--	2.0J	0.87J	--	--	--
	2/10	--	--	--	--	--	12	--	1.4J	1.3J	--	--	--
	8/10	--	--	--	--	--	9.1J	--	2.1J	2.0J	--	--	--
	1/11	--	--	--	--	--	8.4J	--	--	1.7J	--	--	--
	8/11	--	--	--	--	--	9.0J	--	3.2J	2.1J	3.0J	--	--
	1/12	--	--	--	--	--	16	--	--	--	--	--	--
	8/12	--	--	--	--	--	8.3J	--	3.6J	--	--	--	--
	1/13	--	--	--	--	--	9.7J	--	--	--	--	--	--
	8/13	--	--	--	--	--	10	--	--	--	--	--	--
	1/14	--	--	--	--	--	11	--	--	--	--	--	--
	8/14	--	--	--	--	--	9.4J	--	2.2J	--	--	--	--
	1/15	--	--	--	--	--	7.5J	--	2.5J	--	--	--	--
7/15	--	--	--	--	--	9.4J	--	--	--	--	--	--	
1/16	--	--	--	--	--	7.0J	--	--	--	--	--	--	
7/16	--	--	--	--	--	7.5J	--	4.4J	--	--	--	--	
1/17	--	--	--	--	--	12	--	--	--	--	--	--	
7/17	--	--	--	--	--	7.4J	--	--	--	--	--	--	
1/18	--	--	--	--	--	8.3J	--	--	--	--	--	--	
8/18	--	--	--	--	3.5J	7.3J	--	2.1J	0.54J	--	--	--	
6/19	--	--	--	--	--	8.0J	--	--	--	--	--	--	
11/19	--	--	--	--	--	5.9 J	--	--	--	--	--	--	
6/20	--	--	--	--	--	6.3 J	--	--	--	--	--	--	
12/20	--	--	--	--	--	5.8 J	--	1.4 J	--	--	--	--	
4/21	--	--	--	--	--	6.3 J	--	--	--	--	--	--	
11/21	--	--	--	--	--	6.3 J	--	1.0 J	--	--	--	--	
6/22	--	--	--	--	--	6.5J	--	0.83J	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L														
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone			
MW-09D	Well Number	Date Sampled	2/92	--	--	--	--	3 J	--	--	--	--	--	--	--	--
			6/93	--	--	--	--	--	--	--	--	--	--	--	--	--
			11/93	--	--	--	--	4 BJ	--	--	--	--	--	--	--	--
			5/94	--	--	--	--	2 J	--	--	--	--	--	--	--	--
			1/95	--	--	--	--	--	--	--	--	--	--	--	--	--
			6/95	--	--	--	--	2 BJ	--	--	--	--	--	--	--	--
			9/95	--	--	--	--	--	--	--	--	--	--	--	--	--
			11/95	--	--	--	--	--	--	--	--	--	--	--	--	--
			3/96	--	--	--	--	--	--	--	--	--	--	--	--	--
			6/96	--	--	--	--	4 J	--	--	--	--	--	--	--	--
			9/96	--	--	--	--	--	--	--	--	--	--	--	--	--
			12/96	--	--	--	--	--	--	--	--	--	--	--	--	--
			2/97	--	--	2BJ	--	--	--	--	--	--	--	--	--	--
			4/97	--	--	--	--	--	--	--	--	--	--	--	--	--
			7/97	--	--	--	--	--	--	--	--	--	--	--	--	--
			10/97	--	--	--	--	--	--	--	--	--	--	--	--	--
			1/98	--	--	--	--	--	--	--	--	--	--	--	--	--
			8/98	--	--	--	--	--	--	--	--	--	--	--	--	--
			1/99	--	--	--	--	--	--	--	--	--	--	--	--	--
			7/99	--	--	--	--	--	--	--	--	--	--	--	--	--
			1/00	--	--	--	--	--	--	--	--	--	--	--	--	--
			8/00	--	--	--	--	--	--	--	--	--	--	--	--	--
			1/01	--	--	--	2J	--	--	--	--	--	--	--	--	--
			8/01	1BJ	--	--	2J	--	--	--	--	--	--	--	--	--
			1/02	--	--	--	--	--	--	--	--	--	--	--	--	--
			8/02	1BJ	--	3BJ	--	--	--	--	--	--	--	--	--	--
			1/03	--	--	--	--	--	--	--	--	--	--	--	--	--
			7/03	--	--	--	--	--	--	--	--	--	--	--	--	--
			1/04	--	--	--	--	--	--	--	--	--	--	--	--	--
			8/04	--	--	--	--	--	--	--	--	--	--	--	--	--
			1/05	--	--	--	--	--	--	--	--	--	--	--	--	--
			7/05	--	--	--	--	--	--	--	--	--	--	--	--	--
			1/06	--	--	--	--	--	--	--	--	--	--	--	--	--
			8/06	--	--	--	--	--	--	--	--	--	--	--	--	--
			1/07	--	--	--	--	--	--	--	--	--	--	--	--	--
			7/07	--	--	--	--	--	--	--	--	--	--	--	--	--
			1/08	--	--	--	--	--	--	--	--	--	--	--	--	--
			7/08	--	--	--	--	--	--	--	--	--	--	--	--	--
			1/09	--	--	--	--	--	--	--	--	--	--	--	--	--
			7/09	--	--	--	--	--	--	--	--	--	--	--	--	--
			2/10	--	--	--	--	--	--	--	--	--	--	--	--	--
			8/10	--	--	--	--	--	--	--	--	--	--	--	--	--
			1/11	--	--	--	--	--	--	--	--	--	--	--	--	--
			8/11	--	--	--	--	--	--	--	--	--	--	--	--	--
			1/12	--	--	--	--	--	--	--	--	--	--	--	--	--
		8/12	--	--	--	--	--	--	--	--	--	--	--	--	--	
		1/13	--	--	--	--	--	--	--	--	--	--	--	--	--	
		8/13	--	--	--	--	--	--	--	--	--	--	--	--	--	
		1/14	--	--	--	--	--	--	--	--	--	--	--	--	--	
		8/14	--	--	--	--	--	--	--	--	--	--	--	--	--	
		1/15	--	--	--	--	--	--	--	--	--	--	--	--	--	
		7/15	--	--	--	--	--	--	--	--	--	--	--	--	--	
		1/16	--	--	--	--	--	--	--	--	--	--	--	--	--	
		7/16	--	--	--	--	--	--	--	--	--	--	--	--	--	
		1/17	--	--	--	--	--	--	--	--	--	--	--	--	--	
		7/17	--	--	--	--	--	--	--	--	--	--	--	--	--	
		1/18	--	--	--	--	--	--	--	--	--	--	--	--	--	
		8/18	--	--	--	--	--	--	--	--	--	--	--	--	--	
		6/19	--	--	--	--	--	--	--	--	--	--	--	--	--	
		11/19	--	--	--	--	--	--	--	--	--	--	--	--	--	
		6/20	--	--	--	--	--	--	--	--	--	--	--	--	--	
		12/20	--	--	--	--	--	--	--	--	--	--	--	--	--	
		4/21	--	--	--	--	--	--	--	--	--	--	--	--	--	
		11/21	--	--	--	--	--	--	--	--	--	--	--	--	--	
		6/22	--	--	--	--	--	--	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
MW-11	Well Number	Date Sampled	--	--	--	--	--	--	--	--	--	--	--
		11/93	--	--	--	--	--	--	--	--	--	--	--
		5/94	--	--	--	--	--	--	--	--	--	--	--
		1/95	--	--	--	--	--	--	--	--	--	--	--
		6/95	--	--	--	--	--	--	--	--	--	--	--
		9/95	--	--	--	--	--	--	--	--	--	--	--
		11/95	--	--	--	--	--	--	--	--	--	--	--
		3/96	--	--	--	--	--	--	--	--	--	--	--
		6/96	--	--	--	--	--	--	--	--	--	--	--
		9/96	--	--	--	--	--	--	--	--	--	--	--
		12/96	--	--	--	--	--	--	--	--	--	--	--
		2/97	--	--	--	--	--	--	--	--	--	--	--
		4/97	--	--	--	--	--	--	--	--	--	--	--
		7/97	--	--	--	--	--	--	--	--	--	--	--
		10/97	--	--	--	--	--	--	--	--	--	--	--
		1/98	--	--	--	--	--	--	--	--	--	--	--
		8/98	--	--	--	--	--	--	--	--	--	--	--
		1/99	--	30	--	--	--	--	--	--	--	--	--
		7/99	2J	10	--	--	--	--	--	--	--	--	--
		1/00	--	--	--	--	--	--	--	--	--	--	--
		8/00	--	--	--	--	--	--	--	--	--	--	--
		1/01	--	--	--	--	--	--	--	--	--	--	--
		8/01	1BJ	--	--	--	--	--	--	--	--	--	--
		1/02	--	--	--	--	37	2J	--	--	--	--	--
		8/02	2BJ	--	3BJ	2BJ	--	--	--	--	--	--	--
		1/03	--	--	--	--	--	--	--	--	--	--	--
		7/03	--	--	--	--	--	--	--	--	--	--	--
		1/04	--	--	--	--	--	--	--	--	--	--	--
		8/04	--	--	--	--	--	--	--	--	--	--	--
		1/05	--	--	--	--	--	--	--	--	--	--	--
		7/05	--	--	--	--	--	--	--	--	--	--	--
		1/06	--	--	--	--	--	--	--	--	--	--	--
		8/06	--	--	--	--	--	--	--	--	--	--	--
		1/07	--	--	--	--	--	--	--	--	--	--	--
		7/07	--	--	--	--	--	--	--	--	--	--	--
		1/08	--	--	--	--	--	--	--	--	--	--	--
		7/08	--	--	--	--	--	--	--	--	--	--	--
		1/09	--	--	--	--	--	--	--	--	--	--	--
		7/09	--	--	--	--	--	--	--	--	--	--	--
		2/10	--	--	--	--	--	--	--	--	--	--	--
		8/10	--	--	--	--	--	--	--	--	--	--	--
		1/11	--	--	--	--	--	--	--	--	--	--	--
		8/11	--	--	--	--	--	--	--	--	--	--	--
		1/12	--	--	--	--	--	--	--	--	--	--	--
		8/12	--	--	--	--	--	--	--	--	--	--	--
		1/13	--	--	--	--	--	--	--	--	--	--	--
		8/13	--	--	--	--	--	--	--	--	--	--	--
	1/14	--	--	--	--	--	--	--	--	--	--	--	
	8/14	--	--	--	--	--	--	--	--	--	--	--	
	1/15	--	--	--	--	--	--	--	--	--	--	--	
	7/15	--	--	--	--	--	--	--	--	--	--	--	
	1/16	--	--	--	--	--	--	--	--	--	--	--	
	7/16	--	--	--	--	--	--	--	--	--	--	--	
	1/17	--	--	--	--	--	--	--	--	--	--	--	
	7/17	--	--	--	--	--	--	--	--	--	--	--	
	1/18	--	--	--	--	--	--	--	--	--	--	--	
	8/18	--	--	--	--	--	--	--	--	--	--	--	
	6/19	--	--	--	--	--	--	--	--	--	--	--	
	11/19	--	--	--	--	--	--	--	--	--	--	--	
	6/20	--	--	--	--	--	--	--	--	--	--	--	
	12/20	--	--	--	--	--	--	--	--	--	--	--	
	4/21	--	--	--	--	--	--	--	--	--	--	--	
	11/21	--	--	--	--	--	--	--	--	--	--	--	
	6/22	--	--	--	--	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethane	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
MW-12	Well Number	Date Sampled	--	--	--	--	300D	10	--	--	--	--	--
		12/96	--	--	--	--	300D	11	1J	--	--	--	--
		2/97	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
		4/97	--	--	--	--	180D	6J	--	--	--	--	--
		7/97	--	--	--	--	190	7J	--	--	--	--	--
		10/97	--	--	--	--	230D	8J	--	--	--	--	--
		1/98	--	--	--	--	270	5J	--	--	--	--	--
		8/98	--	--	--	--	180	6J	--	--	--	--	--
		1/99	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
		7/99	--	--	--	--	130	5J	--	--	--	--	--
		1/00	--	--	--	--	230E	8J	7J	4J	2J	--	--
		8/00	--	--	--	--	120	4J	1J	--	--	--	--
		8/01	1BJ	--	--	--	78	5J	--	--	--	--	--
		1/02	--	--	--	--	55	3J	2J	1J	--	--	--
		8/02	--	--	4BJ	--	59	4J	--	--	--	--	--
		1/03	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
		7/03	--	--	--	--	56	3J	--	--	--	--	--
		1/04	--	--	--	--	79	3J	--	2J	--	--	--
		8/04	--	--	--	--	14	2J	--	--	--	--	--
		1/05	--	--	--	--	48	2J	--	--	--	--	--
		7/05	--	--	--	--	42	3J	--	--	--	--	--
		1/06	--	--	--	--	50	2J	--	2J	--	--	--
		8/06	--	--	--	--	40	3J	--	--	--	--	--
		1/07	--	--	--	--	37	2J	2J	1J	--	--	--
		7/07	--	--	--	--	31	2J	--	--	--	--	--
		1/08	--	--	--	--	37	--	4J	--	--	--	--
		7/08	--	--	--	--	31	2J	--	--	--	--	--
		1/09	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
		3/09	--	--	--	--	26	1.5 J	1.1 J	0.54 J	--	--	--
		7/09	--	--	--	--	29	1.7J	--	--	--	--	--
		4/10	--	--	--	--	24	--	1.1J	--	--	--	--
		8/10	--	--	--	--	26	--	--	--	--	--	--
		1/11	--	--	--	--	24	--	--	--	--	--	--
		8/11	--	--	--	--	25	--	--	--	--	--	--
		1/12	--	--	--	--	23	--	1.9J	--	--	--	--
		8/12	--	--	--	--	26	--	--	--	--	--	--
		1/13	--	--	--	--	22	--	2.1J	--	--	--	--
		8/13	--	--	--	--	20	--	--	--	--	--	--
		1/14	--	--	--	--	19	--	--	--	--	--	--
		8/14	--	--	--	--	18	--	--	--	--	--	--
		1/15	--	--	--	--	19	--	--	--	--	--	--
		7/15	--	--	--	--	16	--	--	--	--	--	--
		1/16	--	--	--	--	17	--	--	--	--	--	--
		7/16	--	--	--	--	17	--	--	--	--	--	--
	1/17	--	--	--	--	17	--	--	--	--	--	--	
	7/17	--	--	--	--	15	1.0J	--	--	--	--	--	
	1/18	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	
	8/18	--	--	--	--	16	1.1J	--	--	--	--	--	
	6/19	--	--	--	--	11	--	--	--	--	--	--	
	11/19	--	--	--	--	14	1.1 J	--	--	--	--	--	
	6/20	--	--	--	--	10	--	--	--	--	--	--	
	12/20	--	--	--	--	15	--	--	--	--	--	--	
	4/21	--	--	--	--	11	--	--	--	--	--	--	
	11/21	--	--	--	--	15	1.2 J	--	--	--	--	--	
	6/22	--	--	--	--	10	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
MW-13	Well Number	Date Sampled	--	--	--	--	28	9J	1J	--	--	--	--
		12/96	--	--	--	--	15	7J	1J	--	--	--	--
		2/97	--	--	--	--	15	5J	--	--	--	--	--
		4/97	--	--	--	--	11	4J	--	--	--	--	--
		7/97	--	--	--	--	7J	3J	--	--	--	--	--
		10/97	--	--	--	--	10	4J	--	--	--	--	--
		1/98	--	--	--	--	5J	2J	--	--	--	--	--
		8/98	--	--	--	--	3J	3J	--	--	--	--	--
		1/99	--	--	--	--	16	4J	--	--	--	--	--
		7/99	--	--	--	--	9J	3J	--	--	--	--	--
		1/00	--	--	--	--	18	3J	--	--	--	--	--
		8/00	--	--	--	--	24	2J	--	--	--	--	--
		1/01	--	--	--	--	18	2J	--	--	--	--	--
		8/01	1BJ	--	--	--	20	2J	--	--	--	--	--
		1/02	--	--	--	--	14	2J	--	1J	--	--	--
		8/02	1BJ	--	4BJ	3BJ	19	2J	--	--	--	--	--
		1/03	--	--	--	--	12	1J	--	--	--	--	--
		7/03	--	--	--	--	15	2J	--	--	--	--	--
		1/04	--	--	--	--	11	--	--	--	--	--	--
		8/04	--	--	--	--	55	4J	--	--	--	--	--
		1/05	--	--	--	--	8J	--	--	--	--	--	--
		7/05	--	--	--	--	11	2J	--	--	--	--	--
		1/06	--	--	--	--	9J	1J	--	--	--	--	--
		8/06	--	--	--	--	10	1J	--	--	--	--	--
		1/07	--	--	--	--	6J	--	--	--	--	--	--
		7/07	--	--	--	--	7J	1J	--	--	--	--	--
		1/08	--	--	--	--	5J	--	--	--	--	--	--
		7/08	--	--	--	--	7J	1J	--	--	--	--	--
		1/09	--	--	--	--	4.1J	--	--	--	--	--	--
		7/09	--	--	--	--	4.9J	0.81J	--	--	--	--	--
		2/10	--	--	--	--	2.9J	--	--	--	--	--	--
		8/10	--	--	--	--	4.3J	--	--	--	--	--	--
		1/11	--	--	--	--	2.8J	--	--	--	--	--	--
		8/11	--	--	--	--	4.2J	--	--	--	--	--	--
		1/12	--	--	--	--	2.3J	--	--	--	--	--	--
		8/12	--	--	--	--	3.2J	--	--	--	--	--	--
		1/13	--	--	--	--	2.2J	--	--	--	--	--	--
		8/13	--	--	--	--	2.8J	--	--	--	--	--	--
		1/14	--	--	--	--	--	--	--	--	--	--	--
		8/14	--	--	--	--	2.0J	--	--	--	--	--	--
		1/15	--	--	--	--	--	--	--	--	--	--	--
		7/15	--	--	--	--	--	--	--	--	--	--	--
		1/16	--	--	--	--	--	--	--	--	--	--	--
		7/16	--	--	--	--	--	--	--	--	--	--	--
		1/17	--	--	--	--	--	--	--	--	--	--	--
	7/17	--	--	--	--	1.6J	--	--	--	--	--	--	
	1/18	--	--	--	--	1.0J	--	--	--	--	--	--	
	8/18	--	--	--	--	1.4J	--	--	--	--	--	--	
	6/19	--	--	--	--	1.0J	--	--	--	--	--	--	
	11/19	--	--	--	--	0.82 J	--	--	--	--	--	--	
	6/20	--	--	--	--	1.2 J	--	--	--	--	--	--	
	12/20	--	--	--	--	1.2 J	--	--	--	--	--	--	
	4/21	--	--	--	--	1.1 J	--	--	--	--	--	--	
	11/21	--	--	--	--	1.3 J	--	--	--	--	--	--	
	6/22	--	--	--	--	1.0J	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled												
MW-14	8/00	--	--	--	--	--	--	--	--	--	--	--	--
	1/01	--	--	--	--	--	--	--	--	--	--	--	--
	8/01	1BJ	--	--	--	--	--	--	--	--	--	--	--
	1/02	--	--	--	--	--	--	--	--	--	--	--	--
	8/02	1BJ	--	5BJ	4BJ	--	--	--	--	--	--	--	--
	1/03	--	--	--	--	--	--	--	--	--	--	--	--
	7/03	--	--	--	--	--	--	--	--	--	--	--	--
	1/04	--	--	--	--	--	--	--	--	--	--	--	--
	8/04	--	--	--	--	--	--	--	--	--	--	--	--
	1/05	--	--	--	--	--	--	--	--	--	--	--	--
	7/05	--	--	--	--	--	--	--	--	--	--	--	--
	1/06	--	--	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	--	--	--	--	--	--	--	--
	1/07	--	--	--	--	--	--	--	--	--	--	--	--
	7/07	--	--	--	--	--	--	--	--	--	--	--	--
	1/08	--	--	--	--	--	--	--	--	--	--	--	--
	7/08	--	--	--	--	--	--	--	--	--	--	--	--
	1/09	--	--	--	--	--	--	--	--	--	--	--	--
	7/09	--	--	--	--	--	--	--	--	--	--	--	--
	2/10	--	--	--	--	--	--	--	--	--	--	--	--
	8/10	--	--	--	--	--	--	--	--	--	--	--	--
	1/11	--	--	--	--	--	--	--	--	--	--	--	--
	8/11	--	--	--	--	--	--	--	--	--	--	--	--
	1/12	--	--	--	--	--	--	--	--	--	--	--	--
	8/12	--	--	--	--	--	--	--	--	--	--	--	--
	1/13	--	--	--	--	--	--	--	--	--	--	--	--
	8/13	--	--	--	--	--	--	--	--	--	--	--	--
	1/14	--	--	--	--	--	--	--	--	--	--	--	--
	8/14	--	--	--	--	--	--	--	--	--	--	--	--
	1/15	--	--	--	--	--	--	--	--	--	--	--	--
	7/15	--	--	--	--	--	--	--	--	--	--	--	--
	1/16	--	--	--	--	--	--	--	--	--	--	--	--
	7/16	--	--	--	--	--	--	--	--	--	--	--	--
	1/17	--	--	--	--	--	--	--	--	--	--	--	--
	7/17	--	--	--	--	--	--	--	--	--	--	--	--
	1/18	--F1	--F1	--F1	--	--F1	--F1	--F1	--F1	--F1	--	--	--
8/18	--	--	--	--	--	--	--	--	--	--	--	--	
6/19	--	--	--	--	--	--	--	--	--	--	--	--	
11/19	--	--	--	--	--	--	--	--	--	--	--	--	
6/20	--	--	--	--	--	--	--	--	--	--	--	--	
12/20	--	--	--	--	--	--	--	--	--	--	--	--	
4/21	--	--	--	--	--	--	--	--	--	--	--	--	
11/21	--	--	--	--	--	--	--	--	--	--	--	--	
6/22	--	--	--	--	--	--	--	--	--	--	--	--	

NOTES:

- Not Detected
- B Compound was also detected in the associated method blank.
- D Analysis performed at a secondary dilution factor.
- Dup Duplicate Sample
- E Compound was detected above the instruments calibration range thus a secondary dilution was performed.
- J Detected below method detection limit. Value shown is therefore estimated.
- F1 MS or MSD recovery outside of acceptance limits.
- NS No Sample
- (3) Values in parentheses are less than 10 times that found in the field blank or Laboratory method blanks and therefore are not representative of actual site conditions (i.e., artifacts or attributable to laboratory introduced contamination).*
- * Reference: U.S. EPA, 1988. Laboratory Data Validation Functional Guidelines for Evaluating Organics Analyses.
- MW-09 Groundwater well sample (water table)
- MW-09D Groundwater well sample (deep)

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-01 (Relocated 12/99)	10/92	--	0.353	0.442	--	--	--
	6/93	--	0.2	0.25	--	--	--
	11/93	--	NA	NA	--	NA	NA
	5/94	--	0.022	--	--	--	--
	1/95	5*	163	0.205 E	--	--	--
	6/95	0.084	0.161	0.26	--	--	3.0 E
	9/95	--	--	0.0192 SN	--	--	--
	11/95	--	0.0836	0.12	--	--	--
	3/96	--	--	--	0.00065 B	--	--
	6/96	--	--	0.0014 B	--	--	--
	9/96	--	--	0.00098 B	--	--	0.0010 B
	12/96	--	0.041	0.059	--	--	--
	2/97	--	0.0030B	0.0027B	0.00089B	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	--	0.0012B	--	--	--	--
	1/98	--	0.0013B	--	0.0028B	--	--
	8/98	0.0132	0.0146	0.0197	--	--	--
	1/99	0.0018	0.0033	0.0026	0.0007	--	--
	7/99	--	--	0.0037	0.001	--	--
	12/99	--	0.032	0.066	--	--	0.013
	1/00	--	0.02	0.0104	--	0.0025	--
	8/00	--	0.0184	0.0116	0.0012B	--	--
	1/01	--	0.0524	0.0444	--	--	--
	8/01	0.005	0.283	0.276	--	--	--
	1/02	--	0.0607	0.0332	--	--	--
	8/02	--	0.0326	0.0288	--	--	--
	1/03	--	0.0624	0.0561	--	--	--
	7/03	--	0.0787	0.0673	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	0.0215	0.0158	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	0.0344	0.0256	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	0.0055	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0039	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	0.0105	0.0105	--	--	--
	6/19	--	0.0144	0.0103	--	--	--
	11/19	--	--	0.0045	--	--	--
	6/20	--	0.0901	--	--	--	--
	12/20	--	--	--	--	--	--
	12/21	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	0.0068	--	--	--
	6/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-1DA	1/95	0.51	3.09	0.68	--	--	2 BW
	6/95	1.61	1.54	0.29	--	--	--
	9/95	--	0.211	0.141 SN	--	--	--
	11/95	--	0.189	0.0419	--	--	--
	3/96	--	--	--	--	--	--
	6/96	0.0011B	0.0144	0.0063	0.00047 B	--	--
	9/96	0.00023B	0.0119	0.0016B	--	--	0.0016 B
	12/96	--	0.0095B	0.0034	--	--	--
	2/97	--	--	--	0.00069B	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	--	--	--	--	--	--
	1/98	--	0.0015B	--	0.0016B	--	--
	8/98	0.0008	0.0014	--	--	--	--
	1/99	--	0.0015	--	--	0.0021	0.003
	7/99	--	--	--	--	--	--
	12/99	--	0.016	0.015	--	0.0021	0.012
	1/00	--	0.0057	0.003	--	--	--
	8/00	--	0.0429	0.0182	--	--	--
	1/01	--	0.0326	0.0275	--	--	--
	8/01	--	--	0.0034	--	--	--
	1/02	--	--	--	--	--	--
	8/02	--	--	--	--	--	--
	1/03	--	--	--	--	--	--
	7/03	--	--	--	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	0.00365	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	0.0032	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0031	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	--	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	0.0044	--	--	--
	6/20	--	--	--	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-02A	1/95	7.9 *	191	0.295 E	--	--	--
	6/95	0.045	0.059	0.28	--	--	--
	9/95	NS	NS	NS	NS	NS	NS
	11/95	--	0.0454	0.148	--	--	--
	3/96	0.006	0.0368	0.127	--	--	--
	6/96	--	0.0237	0.0935	--	--	--
	9/96	NS	NS	NS	NS	NS	NS
	12/96	--	0.033	0.151	--	--	--
	2/97	0.0128	0.0201	0.0538	0.00078B	--	--
	4/97	--	--	0.0353	--	--	--
	7/97	NS	NS	NS	NS	NS	NS
	10/97	0.0046B	0.0141	0.0606	--	--	--
	1/98	0.0032B	0.03	0.136	--	--	--
	8/98	0.0357	0.0161	0.0955	--	--	--
	1/99	NS	NS	NS	NS	NS	NS
	7/99	NS	NS	NS	NS	NS	NS
	1/00	--	--	0.0032	--	--	--
	1/01	--	--	0.0044	--	--	--
	1/02	--	0.033	--	--	--	--
	1/03	--	--	0.0042	--	--	--
	1/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	0.02460	--	0.01330	--	--	--
	1/09	0.08240	--	0.00481	--	--	--
	7/09	0.60000	0.01590	0.09860	--	--	--
	2/10	0.00550	--	--	--	--	--
	8/10	0.21200	--	0.02940	0.00540	--	0.00300
	1/11	0.14300	--	0.01420	--	--	--
	8/11	NS	NS	NS	NS	NS	NS
	1/12	0.00600	--	--	--	--	--
	8/12	NS	NS	NS	NS	NS	NS
	1/13	0.01590	--	--	--	--	--
	8/13	NS	NS	NS	NS	NS	NS
	1/14	0.0109	--	--	--	--	--
	8/14	0.454	0.0144	0.0323	0.0331	--	--
	1/15	0.463	0.0157	0.0423	--	--	--
	7/15	0.179	--	0.0105	--	--	--
	1/16	0.0228	--	0.0073	--	--	--
	7/16	NS	NS	NS	NS	NS	NS
	1/17	--	--	--	--	--	--
	7/17	0.0237	--	--	0.0084	--	--
	1/18	0.075	--	0.0044	0.0138	--	--
	8/18	NS	NS	NS	NS	NS	NS
	6/19	0.0138	--	--	--	--	--
	11/19	0.0204	--	--	0.0051	--	--
	6/20	--	--	--	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-03	10/92	--	0.254	0.307	--	--	--
	6/93	--	0.26	0.36	--	--	--
	11/93	--	NA	NA	--	NA	NA
	5/94	0.052	0.013	--	--	--	--
	1/95	0.151 *	0.168	0.193 E	--	--	2.1 B
	6/95	0.068	0.121	0.16	--	--	--
	9/95	0.0055	--	--	--	--	--
	11/95	--	0.0276	0.0382	--	--	--
	3/96	0.00063 B	--	--	0.00063 B	--	--
	6/96	--	0.0028 B	0.0031	0.0006 B	--	--
	9/96	--	0.0026 B	0.0014 B	--	--	--
	12/96	--	0.042	0.057	--	--	--
	2/97	0.00070B	--	--	--	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	0.0037	--	--	--
	10/97	--	0.0013B	--	--	--	--
	1/98	--	0.0022B	0.0023B	--	--	--
	8/98	0.0007	--	--	--	--	--
	1/99	0.0031	0.0056	0.0032	--	--	0.0027
	7/99	--	--	--	--	--	--
	1/00	--	0.0047	0.0044	--	--	--
	8/00	--	0.004B	0.0025B	--	--	--
	1/01	--	--	0.0041	--	--	0.0033
	8/01	--	--	--	--	--	--
	1/02	--	--	--	--	--	--
	8/02	--	--	--	--	--	--
	1/03	--	--	--	--	--	--
	7/03	--	--	0.0054	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	0.0031	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	--	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	--	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	0.0037	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	--	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	--	--	--	--
	6/20	--	0.0503	--	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-05	10/92	--	0.45	0.235	--	--	--
	6/93	--	0.19	0.067	--	--	--
	11/93	NS	NS	NS	NS	NS	NS
	5/94	0.011	0.089	0.078	--	--	--
	1/95	--	0.653 *	0.050 *	--	--	--
	6/95	0.02	0.051	0.047	--	--	--
	9/95	--	0.014	0.0286	--	--	--
	11/95	--	0.073	0.0426	--	--	--
	3/96	0.0014 B	0.0315	0.023	--	--	--
	6/96	--	0.0127	0.0108	0.00065 B	--	--
	9/96	--	0.0167	0.018	--	--	--
	12/96	--	0.047	0.034	--	--	--
	2/97	--	--	--	--	--	--
	4/97	--	0.0684	0.0456	--	--	--
	7/97	--	--	--	--	--	--
	10/97	0.0012B	0.0025B	--	0.0011B	--	--
	1/98	--	--	--	--	--	--
	8/98	0.0253	0.0314	0.0199	--	--	--
	1/99	0.0456	0.0585	0.0536	0.0008	--	0.0022
	7/99	--	--	--	--	--	--
	1/00	--	0.0068	--	--	--	--
	8/00	--	0.0300	0.0158	--	--	--
	1/01	--	--	0.0033	--	--	--
	8/01	--	0.0110	0.0094	--	--	--
	1/02	--	0.0178	--	--	--	--
	8/02	--	0.0193	0.0126	--	--	--
	1/03	--	--	--	--	--	--
	7/03	--	0.0150	0.0112	--	--	--
	1/04	--	--	0.0033	--	--	--
	8/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	0.0031	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	0.0204	0.0100	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	0.0167	0.0068	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0032	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	0.185	0.158	--	--	0.0039
	6/19	--	--	--	--	--	--
	11/19	--	--	0.0039	--	--	--
	6/20	--	0.0223	0.0184	--	--	--
	12/20	--	0.129	0.105	--	--	--
	4/21	--	0.0148	0.0148	--	--	--
	11/21	--	0.0197	0.0187	--	--	--
	6/22	--	0.0171	0.0134	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-06A	1/95	0.005	0.103 *	0.240 *	--	--	--
	6/95	0.081	0.084	0.21	--	--	--
	9/95	0.0062	0.012	0.232	--	--	--
	11/95	--	0.117	0.271	--	--	--
	3/96	--	--	--	--	--	--
	6/96	--	0.145	0.388	--	--	--
	9/96	--	0.14	0.323	--	--	--
	12/96	--	0.134	0.345	--	--	--
	2/97	--	--	0.0029B	--	--	--
	4/97	--	0.0745	0.19	--	--	--
	7/97	--	0.0411	0.188	--	--	--
	10/97	0.0019B	0.005B	0.02	0.0051	--	--
	1/98	--	0.0021B	--	0.0011B	--	--
	8/98	0.046	0.0234	0.0544	0.0005	--	--
	1/99	0.0445	0.0241	0.0496	0.0008	0.002	--
	7/99	--	--	0.0095	--	--	--
	1/00	--	--	--	--	--	--
	8/00	--	0.0224	0.0494	--	--	--
	1/01	--	0.0161	0.0325	--	--	--
	8/01	--	0.0288	0.066	--	--	--
	1/02	--	0.014	0.0097	--	--	--
	8/02	--	0.0245	0.0451	--	--	--
	1/03	--	0.0392	0.0854	--	--	--
	7/03	--	--	0.0181	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	0.0059	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	--	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	0.0044	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	--	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	0.0059	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	--	--	--	--
	6/20	--	--	--	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-06DA	1/95	--	0.021	UW	--	0.022	UW
	6/95	--	0.01	0.004	--	--	--
	9/95	--	0.014	0.0096	--	--	--
	11/95	--	--	0.0032	--	--	0.0034
	3/96	--	0.0166	0.0079	--	0.0155	0.0063
	6/96	0.00086 B	0.0412	0.0072	--	0.0414	0.0048
	9/96	--	0.041	0.0026 B	--	0.0397	0.0016 B
	12/96	--	0.022	0.004	0.001B	0.022 B	0.002 B
	2/97	0.0014B	0.0071B	0.0041	--	0.0072 B	0.0020 B
	4/97	--	0.022	0.0072	--	0.0183	--
	7/97	--	0.0569	0.0052	--	0.0577	--
	10/97	0.00066B	0.0143	0.0042	--	0.0144	0.0041
	1/98	--	0.0172	--	--	0.0135	--
	8/98	0.0006	0.0397	0.0035	--	0.0398	--
	1/99	0.0016	0.0278	0.0022	--	0.023	--
	7/99	0.0009	0.0383	0.0024	--	0.0452	--
	1/00	--	0.0153	--	--	0.0124	--
	8/00	--	0.0294	--	--	0.0286	--
	1/01	--	0.0161	--	--	0.0173	--
	8/01	--	--	--	--	0.0103	--
	1/02	--	0.0232	--	--	0.0214	--
	8/02	--	0.0342	--	--	0.0366	--
	1/03	--	0.0165	--	--	0.0167	--
	7/03	--	0.0252	--	--	0.0279	--
	1/04	--	0.0147	--	--	0.0142	--
	8/04	--	0.0281	--	--	0.0279	--
	1/05	--	0.0127	--	--	0.0119	--
	7/05	--	0.0197	--	--	0.0160	--
	1/06	--	--	--	--	--	--
	8/06	--	0.0153	--	--	0.0143	--
	1/07	--	--	--	--	--	--
	7/07	--	0.0119	--	--	0.0122	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	--	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	0.0052	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	0.0057	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	0.0045	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	0.0037
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0030	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	--	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	0.0034	--	--	--
	6/20	--	--	0.0043	--	--	--
	12/20	--	--	0.0058	--	--	--
	4/21	--	--	0.0045	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	0.0155	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-07	10/92	--	0.0386	0.0358	--	--	--
	6/93	--	0.16	0.13	--	--	--
	11/93	NS	NS	NS	NS	NS	NS
	5/94	0.006	0.012	--	--	--	--
	1/95	--	0.113	0.124 E	--	--	2.7 B
	6/95	0.011	0.027	0.024	--	--	--
	9/95	--	0.022	0.054 N	--	--	--
	11/95	--	--	0.0196	--	--	--
	3/96	--	--	--	--	--	--
	6/96	--	0.0012 B	0.0012 B	--	--	--
	9/96	--	--	--	--	--	--
	12/96	--	0.004 B	0.003	--	--	--
	2/97	--	--	0.0016 B	--	--	--
	4/97	--	--	--	--	--	--
	7/97	--	0.014	0.0154	0.0023B	--	--
	10/97	--	0.0012B	--	0.00052B	--	--
	1/98	--	0.0038B	0.0032	0.0024B	--	--
	8/98	0.0239	0.0238	0.029	--	--	--
	1/99	0.0008	0.0029	--	--	--	--
	7/99	--	--	0.0061	--	--	--
	1/00	--	--	--	--	--	--
	8/00	--	0.0037B	0.0037	--	--	--
	1/01	--	--	0.0035	--	--	--
	8/01	--	0.024	0.0227	--	--	--
	1/02	--	--	--	--	--	--
	8/02	--	--	0.0051	--	--	--
	1/03	--	--	--	--	--	--
	7/03	--	0.0699	0.0838	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	0.0037	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	0.0104	0.010	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	0.003	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	--	--	--	--
	7/16	--	--	0.0073	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	0.0047	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	0.0116	0.0141	--	--	--
	6/20	--	--	--	--	--	--
	12/20	--	0.0489	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-09	10/92	0.0915	0.001	--	--	--	--
	6/93	--	0.001	--	--	--	--
	11/93	0.069	NA	NA	--	NA	NA
	5/94	--	--	--	--	--	--
	1/95	0.469 *	0.152	0.163 E	--	--	NA
	6/95	0.078	0.048	0.16	--	--	--
	9/95	0.0458	0.011	0.0651	--	--	--
	11/95	0.0218	0.0632	0.0991	--	--	--
	3/96	--	0.0096 B	--	--	0.0015 B	--
	6/96	--	--	--	0.00045 B	--	--
	9/96	--	--	--	0.00021 B	--	--
	12/96	0.011	0.025	0.040	--	--	--
	2/97	0.0074B	--	--	0.00064B	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	0.0019B	--	--	0.0025B	--	--
	1/98	--	0.0015B	--	0.0012B	--	--
	8/98	0.0112	0.0061	0.0094	0.0012	--	--
	1/99	0.0011	0.0012	--	0.0013	--	0.0038
	7/99	0.0023	--	0.0032	0.0018	--	--
	1/00	0.0038	0.002	0.0042	0.0017	--	--
	8/00	0.0069	0.0075B	0.0079	0.0012B	--	--
	1/01	0.0089	--	0.0125	--	--	--
	8/01	0.006	--	0.0113	--	--	--
	1/02	0.0064	--	--	0.0062	--	--
	8/02	--	--	--	--	--	--
	1/03	0.0085	--	--	0.0057	--	--
	7/03	--	--	0.0049	--	--	--
	1/04	0.0060	--	--	0.0065	--	--
	8/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	--	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0047	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	0.012	--	--	--	--	--
	8/18	0.0066	--	--	--	--	--
	6/19	--	--	--	--	--	--
	11/19	0.027	--	0.0129	--	--	--
	6/20	--	0.0495	--	--	--	--
	12/20	--	0.0189	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	0.0262	0.0367	0.0518	--	--	--
	6/22	--	--	0.0142	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-09D	10/92	--	0.644	0.381	--	--	--
	6/93	--	0.045	0.023	--	--	--
	11/93	--	NA	NA	--	NA	NA
	5/94	--	0.016	--	--	--	--
	1/95	--	0.085	0.052 E	--	--	--
	6/95	0.009	0.02	0.0255 N	--	--	--
	9/95	--	--	0.019	--	--	--
	11/95	--	0.0243	0.019	--	--	--
	3/96	--	0.005 B	--	0.00068	--	--
	6/96	--	0.0031 B	0.0034	0.00046 B	--	--
	9/96	0.00033 B	0.0030 B	0.0010 B	0.00022 B	--	--
	12/96	--	--	--	--	--	--
	2/97	--	--	--	--	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	--	--	--	--	--	--
	1/98	--	--	--	--	--	--
	8/98	0.0012	0.0015	--	--	--	--
	1/99	0.0008	0.0037	--	0.0005	--	--
	7/99	--	--	--	--	--	--
	1/00	--	--	--	--	--	--
	8/00	--	--	--	--	--	--
	1/01	--	--	--	--	--	--
	8/01	--	--	--	--	--	--
	1/02	--	0.0126	--	--	--	--
	8/02	--	--	--	--	--	--
	1/03	--	--	--	--	--	--
	7/03	--	--	--	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	--	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0031	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	0.0040	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	0.0036	--	--	--
	6/20	--	--	0.006	--	--	--
	12/20	--	0.0286	--	--	--	--
	4/21	--	0.0123	0.0095	--	--	--
	11/21	--	--	0.0037	--	--	--
	6/22	--	--	0.0114	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-11	10/92	--	0.595	0.384	--	--	--
	6/93	--	0.1	0.076	--	--	--
	11/93	0.011	NA	NA	--	NA	NA
	5/94	0.017	--	--	--	--	--
	1/95	--	0.253	0.228 E	--	--	--
	6/95	0.087	0.18	0.17	--	--	--
	9/95	--	--	0.005 WN	--	--	--
	11/95	--	0.152	0.161	--	--	0.0077
	3/96	--	--	--	--	--	--
	6/96	--	--	--	--	--	--
	9/96	--	--	0.0013 B	0.00095B	--	--
	12/96	--	0.044	0.054	--	--	--
	2/97	--	0.0124	0.0144	--	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	--	--	--	--	--	--
	1/98	--	0.0138	0.0162	0.0024B	--	--
	8/98	0.0053	0.0065	0.0056	--	--	--
	1/99	0.0050	0.0042	0.0035	0.0029	--	--
	7/99	--	--	--	--	--	--
	1/00	--	0.005	0.0041	--	--	--
	8/00	--	0.0031	--	--	--	--
	1/01	--	--	0.0083	--	--	--
	8/01	--	0.026	0.0264	--	--	--
	1/02	--	--	--	--	--	--
	8/02	--	--	--	--	--	--
	1/03	--	--	0.0053	--	--	--
	7/03	--	--	0.0070	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	0.0031	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	0.0085	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	0.0047	--	--	0.007
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0036	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	--	--	--	--
	6/19	--	--	0.0059	--	--	--
	11/19	--	--	--	--	--	--
	6/20	--	0.162	--	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-12	9/96	--	0.0022B	0.0016B	--	--	--
	12/96	--	0.048	0.053	0.001B	0.003B	--
	2/97	NS	NS	NS	NS	NS	NS
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	--	--	--	--	--	--
	1/98	--	0.0021B	--	--	--	--
	8/98	0.0016	0.0022	--	--	--	--
	1/99	NS	NS	NS	NS	NS	NS
	7/99	--	--	--	--	--	--
	1/00	0.0013	--	--	--	--	--
	8/00	--	--	--	--	--	--
	8/01	--	--	0.0048	--	--	--
	1/02	--	--	--	--	--	--
	8/02	--	--	--	--	--	--
	1/03	NS	NS	NS	NS	NS	NS
	7/03	--	--	0.0060	--	--	--
	1/04	--	--	--	--	--	--
	8/04	0.008	--	0.0058	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	NS	NS	NS	NS	NS	NS
	7/09	--	--	--	--	--	--
	4/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	0.0121	0.0197	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	--	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	NS	NS	NS	NS	NS	NS
	8/18	--	--	0.007	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	--	--	--	--
	6/20	--	--	--	--	--	--
	12/20	--	--	0.0039	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	0.0115	0.0121	--	--	--
	6/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-13	9/96	--	0.0024B	0.0012B	--	--	--
	12/96	--	0.07	0.05	--	--	--
	2/97	--	0.0023B	0.0020B	--	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	--	0.0012B	--	--	--	--
	1/98	--	--	--	0.0042B	--	--
	8/98	0.0086	0.0087	0.0076	--	--	--
	1/99	0.0033	0.002	--	0.0006	0.0017	0.0035
	7/99	--	--	0.002	--	--	--
	1/00	--	--	--	--	--	--
	8/00	--	0.017	0.0093	--	--	--
	1/01	--	--	--	--	--	--
	8/01	--	0.012	0.0094	--	--	--
	1/02	--	0.0107	0.0041	--	--	--
	8/02	--	--	--	--	--	--
	1/03	--	0.0103	0.0036	--	--	--
	7/03	--	0.024	0.0176	--	--	--
	1/04	--	--	--	--	--	0.0035
	8/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	0.0345	--	0.00368	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0030	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	0.0064	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	--	--	--	--
	6/20	--	0.342	0.0034	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-14	8/00	0.005	0.010	0.003	--	--	--
	1/01	--	--	--	--	--	--
	8/01	--	--	--	--	--	--
	1/02	--	--	--	--	--	--
	8/02	--	--	--	--	--	--
	1/03	--	--	--	--	--	--
	7/03	--	--	--	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	0.0824	--	0.00481	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	--	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	--	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	--	--	--	--
	6/20	--	0.0268	--	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	0.0274	0.0231	--	--	--

NOTES:

NA = Not Analyzed

NS = Not Sampled

Abd = Abandoned

* = Indicates duplicate analysis not within control limits.

S = Indicates value determined by Method of Standard Addition.

-- = The analyte was analyzed for but not detected.

B = The reported value was obtained from a reading that was less than the Contract Required Detection Limit (CRDL) but greater than or equal to the Instrument Detection Limit (IDL).

E = Indicates a value estimated or not reported due to the presence of interference.

W = Post digestion spike for Furnace AA analysis out of control limits (85-115%), while sample absorbance is less than 50% of spike absorbance.

N = Indicates spike sample recovery is not within control limits.

ATTACHMENT 3

Analytical Data Package and Field Sampling Report

ANALYTICAL REPORT

Eurofins TestAmerica, Buffalo
10 Hazelwood Drive
Amherst, NY 14228-2298
Tel: (716)691-2600

Laboratory Job ID: 480-192850-1
Client Project/Site: Prestolite site
Sampling Event: Prestolite site

For:
KPRG and Associates, Inc.
14665 West Lisbon Road,
Suite 1A
Brookfield, Wisconsin 53005

Attn: Mr. Rich Gnat



Authorized for release by:
12/3/2021 5:47:36 PM
Rebecca Jones, Project Management Assistant I
Rebecca.Jones@Eurofinset.com
Designee for
Brian Fischer, Manager of Project Management
(716)504-9835
Brian.Fischer@Eurofinset.com

LINKS

Review your project
results through
TotalAccess

Have a Question?



Visit us at:

www.eurofinsus.com/Env

The test results in this report meet all 2003 NELAC, 2009 TNI, and 2016 TNI requirements for accredited parameters, exceptions are noted in this report. This report may not be reproduced except in full, and with written approval from the laboratory. For questions please contact the Project Manager at the e-mail address or telephone number listed on this page.

This report has been electronically signed and authorized by the signatory. Electronic signature is intended to be the legally binding equivalent of a traditionally handwritten signature.

Results relate only to the items tested and the sample(s) as received by the laboratory.

Table of Contents

Cover Page	1
Table of Contents	2
Definitions/Glossary	3
Case Narrative	4
Detection Summary	5
Client Sample Results	7
Surrogate Summary	23
QC Sample Results	24
QC Association Summary	28
Lab Chronicle	31
Certification Summary	35
Method Summary	36
Sample Summary	37
Detection Limit Exceptions Summary	38
Chain of Custody	39
Receipt Checklists	41



Definitions/Glossary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Qualifiers

GC/MS VOA

Qualifier	Qualifier Description
F1	MS and/or MSD recovery exceeds control limits.
F2	MS/MSD RPD exceeds control limits
J	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.
U	Indicates the analyte was analyzed for but not detected.

Metals

Qualifier	Qualifier Description
^+	Continuing Calibration Verification (CCV) is outside acceptance limits, high biased.
U	Indicates the analyte was analyzed for but not detected.

Glossary

Abbreviation	These commonly used abbreviations may or may not be present in this report.
□	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CFL	Contains Free Liquid
CFU	Colony Forming Unit
CNF	Contains No Free Liquid
DER	Duplicate Error Ratio (normalized absolute difference)
Dil Fac	Dilution Factor
DL	Detection Limit (DoD/DOE)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision Level Concentration (Radiochemistry)
EDL	Estimated Detection Limit (Dioxin)
LOD	Limit of Detection (DoD/DOE)
LOQ	Limit of Quantitation (DoD/DOE)
MCL	EPA recommended "Maximum Contaminant Level"
MDA	Minimum Detectable Activity (Radiochemistry)
MDC	Minimum Detectable Concentration (Radiochemistry)
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
MPN	Most Probable Number
MQL	Method Quantitation Limit
NC	Not Calculated
ND	Not Detected at the reporting limit (or MDL or EDL if shown)
NEG	Negative / Absent
POS	Positive / Present
PQL	Practical Quantitation Limit
PRES	Presumptive
QC	Quality Control
RER	Relative Error Ratio (Radiochemistry)
RL	Reporting Limit or Requested Limit (Radiochemistry)
RPD	Relative Percent Difference, a measure of the relative difference between two points
TEF	Toxicity Equivalent Factor (Dioxin)
TEQ	Toxicity Equivalent Quotient (Dioxin)
TNTC	Too Numerous To Count

Case Narrative

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Job ID: 480-192850-1

Laboratory: Eurofins TestAmerica, Buffalo

Narrative

Job Narrative 480-192850-1

Comments

No additional comments.

Receipt

The samples were received on 11/26/2021 12:45 PM. Unless otherwise noted below, the samples arrived in good condition, and where required, properly preserved and on ice. The temperature of the cooler at receipt was 3.7° C.

GC/MS VOA

Method 8260C: The continuing calibration verification (CCV) associated with batch 480-607001 recovered above the upper control limit for Carbon disulfide. The samples associated with this CCV were non-detects for the affected analytes; therefore, the data have been reported. The associated samples are impacted: Dup (480-192850-1), MW-1 (480-192850-2), MW-11 (480-192850-3), MW-12 (480-192850-4), MW-13 (480-192850-5), MW-14 (480-192850-6), MW-1DA (480-192850-7), MW-2A (480-192850-8), MW-3 (480-192850-9), MW-5 (480-192850-10), MW-6A (480-192850-11), MW-6DA (480-192850-12), MW-7 (480-192850-13), MW-9 (480-192850-14), MW-9D (480-192850-15) and TRIP BLANK (480-192850-16).

Method 8260C: The matrix spike / matrix spike duplicate (MS/MSD) recoveries for analytical batch 480-607001 were outside control limits. Sample matrix interference and/or non-homogeneity are suspected because the associated laboratory control sample (LCS) recovery was within acceptance limits.

No additional analytical or quality issues were noted, other than those described above or in the Definitions/Glossary page.

Metals

Method 6010C: The continuing calibration verification (CCV 480-607329/51) associated with batch 480-607329 recovered above the upper control limit for Dissolved Cadmium. The samples associated with this CCV were non-detects for the affected analytes; therefore, the data have been reported.

No additional analytical or quality issues were noted, other than those described above or in the Definitions/Glossary page.

Detection Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: Dup

Lab Sample ID: 480-192850-1

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	21		10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-1

Lab Sample ID: 480-192850-2

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	14		10	0.46	ug/L	1		8260C	Total/NA
Lead	6.8		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: MW-11

Lab Sample ID: 480-192850-3

No Detections.

Client Sample ID: MW-12

Lab Sample ID: 480-192850-4

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
1,1,1-Trichloroethane	1.2	J	10	0.82	ug/L	1		8260C	Total/NA
Trichloroethene	15		10	0.46	ug/L	1		8260C	Total/NA
Chromium	11.5		10.0		ug/L	1		6010C	Total/NA
Lead	12.1		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: MW-13

Lab Sample ID: 480-192850-5

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	1.3	J	10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-14

Lab Sample ID: 480-192850-6

No Detections.

Client Sample ID: MW-1DA

Lab Sample ID: 480-192850-7

No Detections.

Client Sample ID: MW-2A

Lab Sample ID: 480-192850-8

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	1.9	J	10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-3

Lab Sample ID: 480-192850-9

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	0.51	J	10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-5

Lab Sample ID: 480-192850-10

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Acetone	3.2	J	10	3.0	ug/L	1		8260C	Total/NA
Chromium	19.7		10.0		ug/L	1		6010C	Total/NA
Lead	18.7		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: MW-6A

Lab Sample ID: 480-192850-11

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	20		10	0.46	ug/L	1		8260C	Total/NA

This Detection Summary does not include radiochemical test results.

Eurofins TestAmerica, Buffalo

Detection Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-6DA

Lab Sample ID: 480-192850-12

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Chloromethane	0.70	J	10	0.35	ug/L	1		8260C	Total/NA

Client Sample ID: MW-7

Lab Sample ID: 480-192850-13

No Detections.

Client Sample ID: MW-9

Lab Sample ID: 480-192850-14

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	6.3	J	10	0.46	ug/L	1		8260C	Total/NA
1,2-Dichloroethene, Total	1.0	J	10	0.81	ug/L	1		8260C	Total/NA
Cadmium	26.2		5.0		ug/L	1		6010C	Total/NA
Chromium	36.7		10.0		ug/L	1		6010C	Total/NA
Lead	51.8		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: MW-9D

Lab Sample ID: 480-192850-15

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Lead	3.7		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: TRIP BLANK

Lab Sample ID: 480-192850-16

No Detections.

This Detection Summary does not include radiochemical test results.

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: Dup

Lab Sample ID: 480-192850-1

Date Collected: 11/23/21 10:04

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 14:16	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 14:16	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 14:16	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 14:16	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 14:16	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 14:16	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 14:16	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 14:16	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 14:16	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 14:16	1
Acetone	10	U	10	3.0	ug/L			11/30/21 14:16	1
Benzene	10	U	10	0.41	ug/L			11/30/21 14:16	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 14:16	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 14:16	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 14:16	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 14:16	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 14:16	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 14:16	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 14:16	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 14:16	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 14:16	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 14:16	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 14:16	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 14:16	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 14:16	1
Styrene	10	U	10	0.73	ug/L			11/30/21 14:16	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 14:16	1
Toluene	10	U	10	0.51	ug/L			11/30/21 14:16	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 14:16	1
Trichloroethene	21		10	0.46	ug/L			11/30/21 14:16	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 14:16	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 14:16	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 14:16	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	114		77 - 120		11/30/21 14:16	1
Toluene-d8 (Surr)	101		80 - 120		11/30/21 14:16	1
4-Bromofluorobenzene (Surr)	92		73 - 120		11/30/21 14:16	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 21:13	1
Chromium	10.0	U	10.0		ug/L		11/30/21 09:37	11/30/21 21:13	1
Lead	3.0	U	3.0		ug/L		11/30/21 09:37	11/30/21 21:13	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		11/30/21 09:35	12/02/21 02:00	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 02:00	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 02:00	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-1

Lab Sample ID: 480-192850-2

Date Collected: 11/26/21 08:14

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 14:38	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 14:38	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 14:38	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 14:38	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 14:38	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 14:38	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 14:38	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 14:38	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 14:38	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 14:38	1
Acetone	10	U	10	3.0	ug/L			11/30/21 14:38	1
Benzene	10	U	10	0.41	ug/L			11/30/21 14:38	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 14:38	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 14:38	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 14:38	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 14:38	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 14:38	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 14:38	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 14:38	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 14:38	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 14:38	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 14:38	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 14:38	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 14:38	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 14:38	1
Styrene	10	U	10	0.73	ug/L			11/30/21 14:38	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 14:38	1
Toluene	10	U	10	0.51	ug/L			11/30/21 14:38	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 14:38	1
Trichloroethene	14		10	0.46	ug/L			11/30/21 14:38	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 14:38	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 14:38	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 14:38	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	113		77 - 120		11/30/21 14:38	1
Toluene-d8 (Surr)	104		80 - 120		11/30/21 14:38	1
4-Bromofluorobenzene (Surr)	92		73 - 120		11/30/21 14:38	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 21:17	1
Chromium	10.0	U	10.0		ug/L		11/30/21 09:37	11/30/21 21:17	1
Lead	6.8		3.0		ug/L		11/30/21 09:37	11/30/21 21:17	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		11/30/21 09:35	12/02/21 02:04	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 02:04	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 02:04	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-11

Lab Sample ID: 480-192850-3

Date Collected: 11/23/21 14:31

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	F1 U	10	0.82	ug/L			11/30/21 15:00	1
1,1,2,2-Tetrachloroethane	10	F1 U	10	0.21	ug/L			11/30/21 15:00	1
1,1,2-Trichloroethane	10	F1 U	10	0.23	ug/L			11/30/21 15:00	1
1,1-Dichloroethane	10	F1 U	10	0.38	ug/L			11/30/21 15:00	1
1,1-Dichloroethene	10	F1 U	10	0.29	ug/L			11/30/21 15:00	1
1,2-Dichloroethane	10	F1 U	10	0.21	ug/L			11/30/21 15:00	1
1,2-Dichloropropane	10	F1 U	10	0.72	ug/L			11/30/21 15:00	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 15:00	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 15:00	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 15:00	1
Acetone	10	U	10	3.0	ug/L			11/30/21 15:00	1
Benzene	10	F1 U	10	0.41	ug/L			11/30/21 15:00	1
Bromodichloromethane	10	F1 U	10	0.39	ug/L			11/30/21 15:00	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 15:00	1
Bromomethane	10	F1 F2 U	10	0.69	ug/L			11/30/21 15:00	1
Carbon disulfide	10	F1 U	10	0.19	ug/L			11/30/21 15:00	1
Carbon tetrachloride	10	F1 U	10	0.27	ug/L			11/30/21 15:00	1
Chlorobenzene	10	F1 U	10	0.75	ug/L			11/30/21 15:00	1
Dibromochloromethane	10	F1 U	10	0.32	ug/L			11/30/21 15:00	1
Chloroethane	10	F1 U	10	0.32	ug/L			11/30/21 15:00	1
Chloroform	10	F1 U	10	0.34	ug/L			11/30/21 15:00	1
Chloromethane	10	F1 U	10	0.35	ug/L			11/30/21 15:00	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 15:00	1
Ethylbenzene	10	F1 U	10	0.74	ug/L			11/30/21 15:00	1
Methylene Chloride	10	F1 U	10	0.44	ug/L			11/30/21 15:00	1
Styrene	10	F1 U	10	0.73	ug/L			11/30/21 15:00	1
Tetrachloroethene	10	F1 U	10	0.36	ug/L			11/30/21 15:00	1
Toluene	10	F1 U	10	0.51	ug/L			11/30/21 15:00	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 15:00	1
Trichloroethene	10	F1 U	10	0.46	ug/L			11/30/21 15:00	1
Vinyl chloride	10	F1 U	10	0.90	ug/L			11/30/21 15:00	1
Xylenes, Total	10	F1 U	10	0.66	ug/L			11/30/21 15:00	1
1,2-Dichloroethene, Total	10	F1 U	10	0.81	ug/L			11/30/21 15:00	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	115		77 - 120		11/30/21 15:00	1
Toluene-d8 (Surr)	97		80 - 120		11/30/21 15:00	1
4-Bromofluorobenzene (Surr)	89		73 - 120		11/30/21 15:00	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 21:21	1
Chromium	10.0	U	10.0		ug/L		11/30/21 09:37	11/30/21 21:21	1
Lead	3.0	U	3.0		ug/L		11/30/21 09:37	11/30/21 21:21	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		11/30/21 09:35	12/02/21 02:08	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 02:08	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 02:08	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-12

Lab Sample ID: 480-192850-4

Date Collected: 11/23/21 10:42

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	1.2	J	10	0.82	ug/L			11/30/21 15:22	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 15:22	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 15:22	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 15:22	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 15:22	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 15:22	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 15:22	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 15:22	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 15:22	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 15:22	1
Acetone	10	U	10	3.0	ug/L			11/30/21 15:22	1
Benzene	10	U	10	0.41	ug/L			11/30/21 15:22	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 15:22	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 15:22	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 15:22	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 15:22	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 15:22	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 15:22	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 15:22	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 15:22	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 15:22	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 15:22	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 15:22	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 15:22	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 15:22	1
Styrene	10	U	10	0.73	ug/L			11/30/21 15:22	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 15:22	1
Toluene	10	U	10	0.51	ug/L			11/30/21 15:22	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 15:22	1
Trichloroethene	15		10	0.46	ug/L			11/30/21 15:22	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 15:22	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 15:22	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 15:22	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	114		77 - 120		11/30/21 15:22	1
Toluene-d8 (Surr)	99		80 - 120		11/30/21 15:22	1
4-Bromofluorobenzene (Surr)	87		73 - 120		11/30/21 15:22	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 21:50	1
Chromium	11.5		10.0		ug/L		11/30/21 09:37	11/30/21 21:50	1
Lead	12.1		3.0		ug/L		11/30/21 09:37	11/30/21 21:50	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		11/30/21 09:35	12/02/21 02:37	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 02:37	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 02:37	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-13

Lab Sample ID: 480-192850-5

Date Collected: 11/24/21 09:29

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 15:44	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 15:44	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 15:44	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 15:44	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 15:44	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 15:44	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 15:44	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 15:44	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 15:44	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 15:44	1
Acetone	10	U	10	3.0	ug/L			11/30/21 15:44	1
Benzene	10	U	10	0.41	ug/L			11/30/21 15:44	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 15:44	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 15:44	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 15:44	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 15:44	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 15:44	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 15:44	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 15:44	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 15:44	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 15:44	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 15:44	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 15:44	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 15:44	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 15:44	1
Styrene	10	U	10	0.73	ug/L			11/30/21 15:44	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 15:44	1
Toluene	10	U	10	0.51	ug/L			11/30/21 15:44	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 15:44	1
Trichloroethene	1.3	J	10	0.46	ug/L			11/30/21 15:44	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 15:44	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 15:44	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 15:44	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	115		77 - 120		11/30/21 15:44	1
Toluene-d8 (Surr)	101		80 - 120		11/30/21 15:44	1
4-Bromofluorobenzene (Surr)	90		73 - 120		11/30/21 15:44	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 21:54	1
Chromium	10.0	U	10.0		ug/L		11/30/21 09:37	11/30/21 21:54	1
Lead	3.0	U	3.0		ug/L		11/30/21 09:37	11/30/21 21:54	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		11/30/21 09:35	12/02/21 02:41	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 02:41	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 02:41	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-14

Lab Sample ID: 480-192850-6

Date Collected: 11/24/21 08:28

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 16:06	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 16:06	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 16:06	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 16:06	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 16:06	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 16:06	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 16:06	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 16:06	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 16:06	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 16:06	1
Acetone	10	U	10	3.0	ug/L			11/30/21 16:06	1
Benzene	10	U	10	0.41	ug/L			11/30/21 16:06	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 16:06	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 16:06	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 16:06	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 16:06	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 16:06	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 16:06	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 16:06	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 16:06	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 16:06	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 16:06	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 16:06	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 16:06	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 16:06	1
Styrene	10	U	10	0.73	ug/L			11/30/21 16:06	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 16:06	1
Toluene	10	U	10	0.51	ug/L			11/30/21 16:06	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 16:06	1
Trichloroethene	10	U	10	0.46	ug/L			11/30/21 16:06	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 16:06	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 16:06	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 16:06	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	115		77 - 120		11/30/21 16:06	1
Toluene-d8 (Surr)	103		80 - 120		11/30/21 16:06	1
4-Bromofluorobenzene (Surr)	92		73 - 120		11/30/21 16:06	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 21:58	1
Chromium	10.0	U	10.0		ug/L		11/30/21 09:37	11/30/21 21:58	1
Lead	3.0	U	3.0		ug/L		11/30/21 09:37	11/30/21 21:58	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		11/30/21 09:35	12/02/21 02:45	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 02:45	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 02:45	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-1DA

Lab Sample ID: 480-192850-7

Date Collected: 11/24/21 13:05

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 16:28	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 16:28	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 16:28	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 16:28	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 16:28	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 16:28	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 16:28	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 16:28	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 16:28	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 16:28	1
Acetone	10	U	10	3.0	ug/L			11/30/21 16:28	1
Benzene	10	U	10	0.41	ug/L			11/30/21 16:28	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 16:28	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 16:28	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 16:28	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 16:28	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 16:28	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 16:28	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 16:28	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 16:28	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 16:28	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 16:28	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 16:28	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 16:28	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 16:28	1
Styrene	10	U	10	0.73	ug/L			11/30/21 16:28	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 16:28	1
Toluene	10	U	10	0.51	ug/L			11/30/21 16:28	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 16:28	1
Trichloroethene	10	U	10	0.46	ug/L			11/30/21 16:28	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 16:28	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 16:28	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 16:28	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	114		77 - 120		11/30/21 16:28	1
Toluene-d8 (Surr)	100		80 - 120		11/30/21 16:28	1
4-Bromofluorobenzene (Surr)	89		73 - 120		11/30/21 16:28	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 22:01	1
Chromium	10.0	U	10.0		ug/L		11/30/21 09:37	11/30/21 22:01	1
Lead	3.0	U	3.0		ug/L		11/30/21 09:37	11/30/21 22:01	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		11/30/21 09:35	12/02/21 02:49	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 02:49	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 02:49	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-2A

Lab Sample ID: 480-192850-8

Date Collected: 11/23/21 11:22

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 16:50	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 16:50	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 16:50	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 16:50	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 16:50	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 16:50	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 16:50	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 16:50	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 16:50	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 16:50	1
Acetone	10	U	10	3.0	ug/L			11/30/21 16:50	1
Benzene	10	U	10	0.41	ug/L			11/30/21 16:50	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 16:50	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 16:50	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 16:50	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 16:50	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 16:50	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 16:50	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 16:50	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 16:50	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 16:50	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 16:50	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 16:50	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 16:50	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 16:50	1
Styrene	10	U	10	0.73	ug/L			11/30/21 16:50	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 16:50	1
Toluene	10	U	10	0.51	ug/L			11/30/21 16:50	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 16:50	1
Trichloroethene	1.9	J	10	0.46	ug/L			11/30/21 16:50	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 16:50	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 16:50	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 16:50	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	112		77 - 120		11/30/21 16:50	1
Toluene-d8 (Surr)	95		80 - 120		11/30/21 16:50	1
4-Bromofluorobenzene (Surr)	80		73 - 120		11/30/21 16:50	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 22:05	1
Chromium	10.0	U	10.0		ug/L		11/30/21 09:37	11/30/21 22:05	1
Lead	3.0	U	3.0		ug/L		11/30/21 09:37	11/30/21 22:05	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		11/30/21 09:35	12/02/21 02:52	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 02:52	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 02:52	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-3

Lab Sample ID: 480-192850-9

Date Collected: 11/23/21 13:43

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 17:12	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 17:12	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 17:12	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 17:12	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 17:12	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 17:12	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 17:12	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 17:12	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 17:12	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 17:12	1
Acetone	10	U	10	3.0	ug/L			11/30/21 17:12	1
Benzene	10	U	10	0.41	ug/L			11/30/21 17:12	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 17:12	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 17:12	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 17:12	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 17:12	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 17:12	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 17:12	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 17:12	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 17:12	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 17:12	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 17:12	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 17:12	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 17:12	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 17:12	1
Styrene	10	U	10	0.73	ug/L			11/30/21 17:12	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 17:12	1
Toluene	10	U	10	0.51	ug/L			11/30/21 17:12	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 17:12	1
Trichloroethene	0.51	J	10	0.46	ug/L			11/30/21 17:12	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 17:12	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 17:12	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 17:12	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	115		77 - 120		11/30/21 17:12	1
Toluene-d8 (Surr)	105		80 - 120		11/30/21 17:12	1
4-Bromofluorobenzene (Surr)	95		73 - 120		11/30/21 17:12	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 22:09	1
Chromium	10.0	U	10.0		ug/L		11/30/21 09:37	11/30/21 22:09	1
Lead	3.0	U	3.0		ug/L		11/30/21 09:37	11/30/21 22:09	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		11/30/21 09:35	12/02/21 02:56	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 02:56	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 02:56	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-5

Lab Sample ID: 480-192850-10

Date Collected: 11/23/21 14:35

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 17:34	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 17:34	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 17:34	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 17:34	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 17:34	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 17:34	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 17:34	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 17:34	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 17:34	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 17:34	1
Acetone	3.2	J	10	3.0	ug/L			11/30/21 17:34	1
Benzene	10	U	10	0.41	ug/L			11/30/21 17:34	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 17:34	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 17:34	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 17:34	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 17:34	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 17:34	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 17:34	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 17:34	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 17:34	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 17:34	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 17:34	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 17:34	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 17:34	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 17:34	1
Styrene	10	U	10	0.73	ug/L			11/30/21 17:34	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 17:34	1
Toluene	10	U	10	0.51	ug/L			11/30/21 17:34	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 17:34	1
Trichloroethene	10	U	10	0.46	ug/L			11/30/21 17:34	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 17:34	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 17:34	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 17:34	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	115		77 - 120		11/30/21 17:34	1
Toluene-d8 (Surr)	101		80 - 120		11/30/21 17:34	1
4-Bromofluorobenzene (Surr)	92		73 - 120		11/30/21 17:34	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 22:12	1
Chromium	19.7		10.0		ug/L		11/30/21 09:37	11/30/21 22:12	1
Lead	18.7		3.0		ug/L		11/30/21 09:37	11/30/21 22:12	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		11/30/21 09:35	12/02/21 03:00	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 03:00	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 03:00	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-6A

Lab Sample ID: 480-192850-11

Date Collected: 11/23/21 10:04

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 17:56	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 17:56	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 17:56	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 17:56	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 17:56	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 17:56	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 17:56	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 17:56	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 17:56	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 17:56	1
Acetone	10	U	10	3.0	ug/L			11/30/21 17:56	1
Benzene	10	U	10	0.41	ug/L			11/30/21 17:56	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 17:56	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 17:56	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 17:56	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 17:56	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 17:56	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 17:56	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 17:56	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 17:56	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 17:56	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 17:56	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 17:56	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 17:56	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 17:56	1
Styrene	10	U	10	0.73	ug/L			11/30/21 17:56	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 17:56	1
Toluene	10	U	10	0.51	ug/L			11/30/21 17:56	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 17:56	1
Trichloroethene	20		10	0.46	ug/L			11/30/21 17:56	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 17:56	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 17:56	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 17:56	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	114		77 - 120		11/30/21 17:56	1
Toluene-d8 (Surr)	97		80 - 120		11/30/21 17:56	1
4-Bromofluorobenzene (Surr)	83		73 - 120		11/30/21 17:56	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 22:16	1
Chromium	10.0	U	10.0		ug/L		11/30/21 09:37	11/30/21 22:16	1
Lead	3.0	U	3.0		ug/L		11/30/21 09:37	11/30/21 22:16	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		11/30/21 09:35	12/02/21 03:04	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 03:04	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 03:04	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-6DA

Lab Sample ID: 480-192850-12

Date Collected: 11/23/21 09:20

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 18:18	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 18:18	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 18:18	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 18:18	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 18:18	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 18:18	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 18:18	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 18:18	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 18:18	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 18:18	1
Acetone	10	U	10	3.0	ug/L			11/30/21 18:18	1
Benzene	10	U	10	0.41	ug/L			11/30/21 18:18	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 18:18	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 18:18	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 18:18	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 18:18	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 18:18	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 18:18	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 18:18	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 18:18	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 18:18	1
Chloromethane	0.70	J	10	0.35	ug/L			11/30/21 18:18	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 18:18	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 18:18	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 18:18	1
Styrene	10	U	10	0.73	ug/L			11/30/21 18:18	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 18:18	1
Toluene	10	U	10	0.51	ug/L			11/30/21 18:18	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 18:18	1
Trichloroethene	10	U	10	0.46	ug/L			11/30/21 18:18	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 18:18	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 18:18	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 18:18	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	115		77 - 120		11/30/21 18:18	1
Toluene-d8 (Surr)	104		80 - 120		11/30/21 18:18	1
4-Bromofluorobenzene (Surr)	95		73 - 120		11/30/21 18:18	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 22:31	1
Chromium	10.0	U	10.0		ug/L		11/30/21 09:37	11/30/21 22:31	1
Lead	3.0	U	3.0		ug/L		11/30/21 09:37	11/30/21 22:31	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	^+ U	5.0		ug/L		11/30/21 09:35	12/02/21 03:18	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 03:18	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 03:18	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-7

Lab Sample ID: 480-192850-13

Date Collected: 11/23/21 12:44

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 18:40	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 18:40	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 18:40	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 18:40	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 18:40	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 18:40	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 18:40	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 18:40	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 18:40	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 18:40	1
Acetone	10	U	10	3.0	ug/L			11/30/21 18:40	1
Benzene	10	U	10	0.41	ug/L			11/30/21 18:40	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 18:40	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 18:40	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 18:40	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 18:40	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 18:40	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 18:40	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 18:40	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 18:40	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 18:40	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 18:40	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 18:40	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 18:40	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 18:40	1
Styrene	10	U	10	0.73	ug/L			11/30/21 18:40	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 18:40	1
Toluene	10	U	10	0.51	ug/L			11/30/21 18:40	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 18:40	1
Trichloroethene	10	U	10	0.46	ug/L			11/30/21 18:40	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 18:40	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 18:40	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 18:40	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	116		77 - 120		11/30/21 18:40	1
Toluene-d8 (Surr)	97		80 - 120		11/30/21 18:40	1
4-Bromofluorobenzene (Surr)	84		73 - 120		11/30/21 18:40	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 22:35	1
Chromium	10.0	U	10.0		ug/L		11/30/21 09:37	11/30/21 22:35	1
Lead	3.0	U	3.0		ug/L		11/30/21 09:37	11/30/21 22:35	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	^+ U	5.0		ug/L		11/30/21 09:35	12/02/21 03:22	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 03:22	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 03:22	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-9

Lab Sample ID: 480-192850-14

Date Collected: 11/26/21 09:20

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 19:03	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 19:03	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 19:03	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 19:03	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 19:03	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 19:03	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 19:03	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 19:03	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 19:03	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 19:03	1
Acetone	10	U	10	3.0	ug/L			11/30/21 19:03	1
Benzene	10	U	10	0.41	ug/L			11/30/21 19:03	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 19:03	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 19:03	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 19:03	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 19:03	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 19:03	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 19:03	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 19:03	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 19:03	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 19:03	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 19:03	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 19:03	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 19:03	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 19:03	1
Styrene	10	U	10	0.73	ug/L			11/30/21 19:03	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 19:03	1
Toluene	10	U	10	0.51	ug/L			11/30/21 19:03	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 19:03	1
Trichloroethene	6.3	J	10	0.46	ug/L			11/30/21 19:03	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 19:03	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 19:03	1
1,2-Dichloroethene, Total	1.0	J	10	0.81	ug/L			11/30/21 19:03	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	115		77 - 120		11/30/21 19:03	1
Toluene-d8 (Surr)	101		80 - 120		11/30/21 19:03	1
4-Bromofluorobenzene (Surr)	93		73 - 120		11/30/21 19:03	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	26.2		5.0		ug/L		11/30/21 09:37	11/30/21 22:39	1
Chromium	36.7		10.0		ug/L		11/30/21 09:37	11/30/21 22:39	1
Lead	51.8		3.0		ug/L		11/30/21 09:37	11/30/21 22:39	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	^+ U	5.0		ug/L		11/30/21 09:35	12/02/21 03:26	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 03:26	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 03:26	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-9D

Lab Sample ID: 480-192850-15

Date Collected: 11/26/21 10:50

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 19:24	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 19:24	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 19:24	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 19:24	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 19:24	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 19:24	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 19:24	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 19:24	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 19:24	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 19:24	1
Acetone	10	U	10	3.0	ug/L			11/30/21 19:24	1
Benzene	10	U	10	0.41	ug/L			11/30/21 19:24	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 19:24	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 19:24	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 19:24	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 19:24	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 19:24	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 19:24	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 19:24	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 19:24	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 19:24	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 19:24	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 19:24	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 19:24	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 19:24	1
Styrene	10	U	10	0.73	ug/L			11/30/21 19:24	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 19:24	1
Toluene	10	U	10	0.51	ug/L			11/30/21 19:24	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 19:24	1
Trichloroethene	10	U	10	0.46	ug/L			11/30/21 19:24	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 19:24	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 19:24	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 19:24	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	115		77 - 120		11/30/21 19:24	1
Toluene-d8 (Surr)	100		80 - 120		11/30/21 19:24	1
4-Bromofluorobenzene (Surr)	84		73 - 120		11/30/21 19:24	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 22:42	1
Chromium	10.0	U	10.0		ug/L		11/30/21 09:37	11/30/21 22:42	1
Lead	3.7		3.0		ug/L		11/30/21 09:37	11/30/21 22:42	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	^+ U	5.0		ug/L		11/30/21 09:35	12/02/21 03:30	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 03:30	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 03:30	1

Eurofins TestAmerica, Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: TRIP BLANK

Lab Sample ID: 480-192850-16

Date Collected: 11/23/21 10:30

Matrix: Ground Water

Date Received: 11/26/21 12:45

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 19:47	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 19:47	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 19:47	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 19:47	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 19:47	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 19:47	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 19:47	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 19:47	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 19:47	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 19:47	1
Acetone	10	U	10	3.0	ug/L			11/30/21 19:47	1
Benzene	10	U	10	0.41	ug/L			11/30/21 19:47	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 19:47	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 19:47	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 19:47	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 19:47	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 19:47	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 19:47	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 19:47	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 19:47	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 19:47	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 19:47	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 19:47	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 19:47	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 19:47	1
Styrene	10	U	10	0.73	ug/L			11/30/21 19:47	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 19:47	1
Toluene	10	U	10	0.51	ug/L			11/30/21 19:47	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 19:47	1
Trichloroethene	10	U	10	0.46	ug/L			11/30/21 19:47	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 19:47	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 19:47	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 19:47	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	115		77 - 120		11/30/21 19:47	1
Toluene-d8 (Surr)	102		80 - 120		11/30/21 19:47	1
4-Bromofluorobenzene (Surr)	93		73 - 120		11/30/21 19:47	1

Surrogate Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Method: 8260C - Volatile Organic Compounds by GC/MS

Matrix: Ground Water

Prep Type: Total/NA

Lab Sample ID	Client Sample ID	Percent Surrogate Recovery (Acceptance Limits)		
		DCA (77-120)	TOL (80-120)	BFB (73-120)
480-192850-1	Dup	114	101	92
480-192850-2	MW-1	113	104	92
480-192850-3	MW-11	115	97	89
480-192850-3 MS	MW-11	106	98	88
480-192850-3 MSD	MW-11	107	102	100
480-192850-4	MW-12	114	99	87
480-192850-5	MW-13	115	101	90
480-192850-6	MW-14	115	103	92
480-192850-7	MW-1DA	114	100	89
480-192850-8	MW-2A	112	95	80
480-192850-9	MW-3	115	105	95
480-192850-10	MW-5	115	101	92
480-192850-11	MW-6A	114	97	83
480-192850-12	MW-6DA	115	104	95
480-192850-13	MW-7	116	97	84
480-192850-14	MW-9	115	101	93
480-192850-15	MW-9D	115	100	84
480-192850-16	TRIP BLANK	115	102	93
Surrogate Legend				
DCA = 1,2-Dichloroethane-d4 (Surr)				
TOL = Toluene-d8 (Surr)				
BFB = 4-Bromofluorobenzene (Surr)				

Method: 8260C - Volatile Organic Compounds by GC/MS

Matrix: Water

Prep Type: Total/NA

Lab Sample ID	Client Sample ID	Percent Surrogate Recovery (Acceptance Limits)		
		DCA (77-120)	TOL (80-120)	BFB (73-120)
LCS 480-607001/5	Lab Control Sample	106	105	99
MB 480-607001/7	Method Blank	112	101	96
Surrogate Legend				
DCA = 1,2-Dichloroethane-d4 (Surr)				
TOL = Toluene-d8 (Surr)				
BFB = 4-Bromofluorobenzene (Surr)				

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Method: 8260C - Volatile Organic Compounds by GC/MS

Lab Sample ID: MB 480-607001/7

Matrix: Water

Analysis Batch: 607001

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			11/30/21 11:05	1
1,1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			11/30/21 11:05	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			11/30/21 11:05	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			11/30/21 11:05	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			11/30/21 11:05	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			11/30/21 11:05	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			11/30/21 11:05	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			11/30/21 11:05	1
2-Hexanone	10	U	10	1.2	ug/L			11/30/21 11:05	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			11/30/21 11:05	1
Acetone	10	U	10	3.0	ug/L			11/30/21 11:05	1
Benzene	10	U	10	0.41	ug/L			11/30/21 11:05	1
Bromodichloromethane	10	U	10	0.39	ug/L			11/30/21 11:05	1
Bromoform	10	U	10	0.26	ug/L			11/30/21 11:05	1
Bromomethane	10	U	10	0.69	ug/L			11/30/21 11:05	1
Carbon disulfide	10	U	10	0.19	ug/L			11/30/21 11:05	1
Carbon tetrachloride	10	U	10	0.27	ug/L			11/30/21 11:05	1
Chlorobenzene	10	U	10	0.75	ug/L			11/30/21 11:05	1
Dibromochloromethane	10	U	10	0.32	ug/L			11/30/21 11:05	1
Chloroethane	10	U	10	0.32	ug/L			11/30/21 11:05	1
Chloroform	10	U	10	0.34	ug/L			11/30/21 11:05	1
Chloromethane	10	U	10	0.35	ug/L			11/30/21 11:05	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			11/30/21 11:05	1
Ethylbenzene	10	U	10	0.74	ug/L			11/30/21 11:05	1
Methylene Chloride	10	U	10	0.44	ug/L			11/30/21 11:05	1
Styrene	10	U	10	0.73	ug/L			11/30/21 11:05	1
Tetrachloroethene	10	U	10	0.36	ug/L			11/30/21 11:05	1
Toluene	10	U	10	0.51	ug/L			11/30/21 11:05	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			11/30/21 11:05	1
Trichloroethene	10	U	10	0.46	ug/L			11/30/21 11:05	1
Vinyl chloride	10	U	10	0.90	ug/L			11/30/21 11:05	1
Xylenes, Total	10	U	10	0.66	ug/L			11/30/21 11:05	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			11/30/21 11:05	1

Surrogate	MB %Recovery	MB Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	112		77 - 120		11/30/21 11:05	1
Toluene-d8 (Surr)	101		80 - 120		11/30/21 11:05	1
4-Bromofluorobenzene (Surr)	96		73 - 120		11/30/21 11:05	1

Lab Sample ID: LCS 480-607001/5

Matrix: Water

Analysis Batch: 607001

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec. Limits
1,1-Dichloroethane	25.0	29.1		ug/L		116	77 - 120
Benzene	25.0	28.7		ug/L		115	71 - 124
Chlorobenzene	25.0	25.1		ug/L		101	80 - 120
Toluene	25.0	25.7		ug/L		103	80 - 122

Eurofins TestAmerica, Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Method: 8260C - Volatile Organic Compounds by GC/MS (Continued)

Lab Sample ID: LCS 480-607001/5

Matrix: Water

Analysis Batch: 607001

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec. Limits
Trichloroethene	25.0	26.4		ug/L		106	74 - 123
Surrogate	LCS %Recovery	LCS Qualifier	Limits				
1,2-Dichloroethane-d4 (Surr)	106		77 - 120				
Toluene-d8 (Surr)	105		80 - 120				
4-Bromofluorobenzene (Surr)	99		73 - 120				

Lab Sample ID: 480-192850-3 MS

Matrix: Ground Water

Analysis Batch: 607001

Client Sample ID: MW-11

Prep Type: Total/NA

	Sample	Sample	Spike	MS	MS				%Rec.		
Analyte	Result	Qualifier	Added	Result	Qualifier	Unit	D	%Rec	Limits		
1,1-Dichloroethane	10	F1	25.0	38.3	F1	ug/L		153	77 - 120		
Benzene	10	F1	25.0	37.7	F1	ug/L		151	71 - 124		
Chlorobenzene	10	F1	25.0	31.1	F1	ug/L		125	80 - 120		
Toluene	10	F1	25.0	32.8	F1	ug/L		131	80 - 122		
Trichloroethene	10	F1	25.0	34.0	F1	ug/L		136	74 - 123		
Surrogate	MS	MS									
	%Recovery	Qualifier	Limits								
1,2-Dichloroethane-d4 (Surr)	106		77 - 120								
Toluene-d8 (Surr)	98		80 - 120								
4-Bromofluorobenzene (Surr)	88		73 - 120								

Lab Sample ID: 480-192850-3 MSD

Matrix: Ground Water

Analysis Batch: 607001

Client Sample ID: MW-11

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec. Limits	RPD	Limit
1,1-Dichloroethane	10	F1	25.0	37.4	F1	ug/L		149	77 - 120	2	20
Benzene	10	F1	25.0	37.1	F1	ug/L		148	71 - 124	2	13
Chlorobenzene	10	F1	25.0	30.5	F1	ug/L		122	80 - 120	2	25
Toluene	10	F1	25.0	32.1	F1	ug/L		129	80 - 122	2	15
Trichloroethene	10	F1	25.0	34.1	F1	ug/L		137	74 - 123	0	16
Surrogate	MSD %Recovery	MSD Qualifier	Limits								
1,2-Dichloroethane-d4 (Surr)	107		77 - 120								
Toluene-d8 (Surr)	102		80 - 120								
4-Bromofluorobenzene (Surr)	100		73 - 120								

Method: 6010C - Metals (ICP)

Lab Sample ID: MB 480-606944/1-A

Matrix: Water

Analysis Batch: 607220

Client Sample ID: Method Blank

Prep Type: Total/NA

Prep Batch: 606944

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		11/30/21 09:37	11/30/21 21:06	1
Chromium	10.0	U	10.0		ug/L		11/30/21 09:37	11/30/21 21:06	1

Eurofins TestAmerica, Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Method: 6010C - Metals (ICP) (Continued)

Lab Sample ID: MB 480-606944/1-A

Matrix: Water

Analysis Batch: 607220

Client Sample ID: Method Blank

Prep Type: Total/NA

Prep Batch: 606944

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Lead	3.0	U	3.0		ug/L		11/30/21 09:37	11/30/21 21:06	1

Lab Sample ID: LCS 480-606944/2-A

Matrix: Water

Analysis Batch: 607220

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Prep Batch: 606944

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec. Limits
Cadmium	200	201.6		ug/L		101	80 - 120
Chromium	200	196.0		ug/L		98	80 - 120
Lead	200	197.4		ug/L		99	80 - 120

Lab Sample ID: 480-192850-3 MS

Matrix: Ground Water

Analysis Batch: 607220

Client Sample ID: MW-11

Prep Type: Total/NA

Prep Batch: 606944

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec. Limits
Cadmium	5.0		200	197.5		ug/L		99	75 - 125
Chromium	10.0		200	194.1		ug/L		97	75 - 125
Lead	3.0		200	195.7		ug/L		98	75 - 125

Lab Sample ID: 480-192850-3 MSD

Matrix: Ground Water

Analysis Batch: 607220

Client Sample ID: MW-11

Prep Type: Total/NA

Prep Batch: 606944

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec. Limits	RPD	RPD Limit
Cadmium	5.0		200	198.2		ug/L		99	75 - 125	0	20
Chromium	10.0		200	194.3		ug/L		97	75 - 125	0	20
Lead	3.0		200	198.3		ug/L		99	75 - 125	1	20

Lab Sample ID: MB 480-606948/1-A

Matrix: Water

Analysis Batch: 607329

Client Sample ID: Method Blank

Prep Type: Total Recoverable

Prep Batch: 606948

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		11/30/21 09:35	12/02/21 01:53	1
Chromium, Dissolved	10.0	U	10.0		ug/L		11/30/21 09:35	12/02/21 01:53	1
Lead, Dissolved	3.0	U	3.0		ug/L		11/30/21 09:35	12/02/21 01:53	1

Lab Sample ID: LCS 480-606948/2-A

Matrix: Water

Analysis Batch: 607329

Client Sample ID: Lab Control Sample

Prep Type: Total Recoverable

Prep Batch: 606948

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec. Limits
Cadmium, Dissolved	200	213.9		ug/L		107	80 - 120
Chromium, Dissolved	200	198.0		ug/L		99	80 - 120
Lead, Dissolved	200	196.7		ug/L		98	80 - 120

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Method: 6010C - Metals (ICP) (Continued)

Lab Sample ID: 480-192850-3 MS
Matrix: Ground Water
Analysis Batch: 607329

Client Sample ID: MW-11
Prep Type: Dissolved
Prep Batch: 606948

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec. Limits
Cadmium, Dissolved	5.0		200	199.4		ug/L		100	75 - 125
Chromium, Dissolved	10.0		200	178.2		ug/L		89	75 - 125
Lead, Dissolved	3.0		200	183.4		ug/L		92	75 - 125

Lab Sample ID: 480-192850-3 MSD
Matrix: Ground Water
Analysis Batch: 607329

Client Sample ID: MW-11
Prep Type: Dissolved
Prep Batch: 606948

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec. Limits	RPD	RPD Limit
Cadmium, Dissolved	5.0		200	210.3		ug/L		105	75 - 125	5	20
Chromium, Dissolved	10.0		200	188.0		ug/L		94	75 - 125	5	20
Lead, Dissolved	3.0		200	194.5		ug/L		97	75 - 125	6	20

QC Association Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

GC/MS VOA

Analysis Batch: 607001

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-192850-1	Dup	Total/NA	Ground Water	8260C	
480-192850-2	MW-1	Total/NA	Ground Water	8260C	
480-192850-3	MW-11	Total/NA	Ground Water	8260C	
480-192850-4	MW-12	Total/NA	Ground Water	8260C	
480-192850-5	MW-13	Total/NA	Ground Water	8260C	
480-192850-6	MW-14	Total/NA	Ground Water	8260C	
480-192850-7	MW-1DA	Total/NA	Ground Water	8260C	
480-192850-8	MW-2A	Total/NA	Ground Water	8260C	
480-192850-9	MW-3	Total/NA	Ground Water	8260C	
480-192850-10	MW-5	Total/NA	Ground Water	8260C	
480-192850-11	MW-6A	Total/NA	Ground Water	8260C	
480-192850-12	MW-6DA	Total/NA	Ground Water	8260C	
480-192850-13	MW-7	Total/NA	Ground Water	8260C	
480-192850-14	MW-9	Total/NA	Ground Water	8260C	
480-192850-15	MW-9D	Total/NA	Ground Water	8260C	
480-192850-16	TRIP BLANK	Total/NA	Ground Water	8260C	
MB 480-607001/7	Method Blank	Total/NA	Water	8260C	
LCS 480-607001/5	Lab Control Sample	Total/NA	Water	8260C	
480-192850-3 MS	MW-11	Total/NA	Ground Water	8260C	
480-192850-3 MSD	MW-11	Total/NA	Ground Water	8260C	

Metals

Prep Batch: 606944

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-192850-1	Dup	Total/NA	Ground Water	3005A	
480-192850-2	MW-1	Total/NA	Ground Water	3005A	
480-192850-3	MW-11	Total/NA	Ground Water	3005A	
480-192850-4	MW-12	Total/NA	Ground Water	3005A	
480-192850-5	MW-13	Total/NA	Ground Water	3005A	
480-192850-6	MW-14	Total/NA	Ground Water	3005A	
480-192850-7	MW-1DA	Total/NA	Ground Water	3005A	
480-192850-8	MW-2A	Total/NA	Ground Water	3005A	
480-192850-9	MW-3	Total/NA	Ground Water	3005A	
480-192850-10	MW-5	Total/NA	Ground Water	3005A	
480-192850-11	MW-6A	Total/NA	Ground Water	3005A	
480-192850-12	MW-6DA	Total/NA	Ground Water	3005A	
480-192850-13	MW-7	Total/NA	Ground Water	3005A	
480-192850-14	MW-9	Total/NA	Ground Water	3005A	
480-192850-15	MW-9D	Total/NA	Ground Water	3005A	
MB 480-606944/1-A	Method Blank	Total/NA	Water	3005A	
LCS 480-606944/2-A	Lab Control Sample	Total/NA	Water	3005A	
480-192850-3 MS	MW-11	Total/NA	Ground Water	3005A	
480-192850-3 MSD	MW-11	Total/NA	Ground Water	3005A	

Prep Batch: 606948

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-192850-1	Dup	Dissolved	Ground Water	3005A	
480-192850-2	MW-1	Dissolved	Ground Water	3005A	
480-192850-3	MW-11	Dissolved	Ground Water	3005A	
480-192850-4	MW-12	Dissolved	Ground Water	3005A	

Eurofins TestAmerica, Buffalo

QC Association Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Metals (Continued)

Prep Batch: 606948 (Continued)

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-192850-5	MW-13	Dissolved	Ground Water	3005A	
480-192850-6	MW-14	Dissolved	Ground Water	3005A	
480-192850-7	MW-1DA	Dissolved	Ground Water	3005A	
480-192850-8	MW-2A	Dissolved	Ground Water	3005A	
480-192850-9	MW-3	Dissolved	Ground Water	3005A	
480-192850-10	MW-5	Dissolved	Ground Water	3005A	
480-192850-11	MW-6A	Dissolved	Ground Water	3005A	
480-192850-12	MW-6DA	Dissolved	Ground Water	3005A	
480-192850-13	MW-7	Dissolved	Ground Water	3005A	
480-192850-14	MW-9	Dissolved	Ground Water	3005A	
480-192850-15	MW-9D	Dissolved	Ground Water	3005A	
MB 480-606948/1-A	Method Blank	Total Recoverable	Water	3005A	
LCS 480-606948/2-A	Lab Control Sample	Total Recoverable	Water	3005A	
480-192850-3 MS	MW-11	Dissolved	Ground Water	3005A	
480-192850-3 MSD	MW-11	Dissolved	Ground Water	3005A	

Analysis Batch: 607220

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-192850-1	Dup	Total/NA	Ground Water	6010C	606944
480-192850-2	MW-1	Total/NA	Ground Water	6010C	606944
480-192850-3	MW-11	Total/NA	Ground Water	6010C	606944
480-192850-4	MW-12	Total/NA	Ground Water	6010C	606944
480-192850-5	MW-13	Total/NA	Ground Water	6010C	606944
480-192850-6	MW-14	Total/NA	Ground Water	6010C	606944
480-192850-7	MW-1DA	Total/NA	Ground Water	6010C	606944
480-192850-8	MW-2A	Total/NA	Ground Water	6010C	606944
480-192850-9	MW-3	Total/NA	Ground Water	6010C	606944
480-192850-10	MW-5	Total/NA	Ground Water	6010C	606944
480-192850-11	MW-6A	Total/NA	Ground Water	6010C	606944
480-192850-12	MW-6DA	Total/NA	Ground Water	6010C	606944
480-192850-13	MW-7	Total/NA	Ground Water	6010C	606944
480-192850-14	MW-9	Total/NA	Ground Water	6010C	606944
480-192850-15	MW-9D	Total/NA	Ground Water	6010C	606944
MB 480-606944/1-A	Method Blank	Total/NA	Water	6010C	606944
LCS 480-606944/2-A	Lab Control Sample	Total/NA	Water	6010C	606944
480-192850-3 MS	MW-11	Total/NA	Ground Water	6010C	606944
480-192850-3 MSD	MW-11	Total/NA	Ground Water	6010C	606944

Analysis Batch: 607329

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-192850-1	Dup	Dissolved	Ground Water	6010C	606948
480-192850-2	MW-1	Dissolved	Ground Water	6010C	606948
480-192850-3	MW-11	Dissolved	Ground Water	6010C	606948
480-192850-4	MW-12	Dissolved	Ground Water	6010C	606948
480-192850-5	MW-13	Dissolved	Ground Water	6010C	606948
480-192850-6	MW-14	Dissolved	Ground Water	6010C	606948
480-192850-7	MW-1DA	Dissolved	Ground Water	6010C	606948
480-192850-8	MW-2A	Dissolved	Ground Water	6010C	606948
480-192850-9	MW-3	Dissolved	Ground Water	6010C	606948
480-192850-10	MW-5	Dissolved	Ground Water	6010C	606948
480-192850-11	MW-6A	Dissolved	Ground Water	6010C	606948

Eurofins TestAmerica, Buffalo

QC Association Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Metals (Continued)

Analysis Batch: 607329 (Continued)

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-192850-12	MW-6DA	Dissolved	Ground Water	6010C	606948
480-192850-13	MW-7	Dissolved	Ground Water	6010C	606948
480-192850-14	MW-9	Dissolved	Ground Water	6010C	606948
480-192850-15	MW-9D	Dissolved	Ground Water	6010C	606948
MB 480-606948/1-A	Method Blank	Total Recoverable	Water	6010C	606948
LCS 480-606948/2-A	Lab Control Sample	Total Recoverable	Water	6010C	606948
480-192850-3 MS	MW-11	Dissolved	Ground Water	6010C	606948
480-192850-3 MSD	MW-11	Dissolved	Ground Water	6010C	606948

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: Dup

Lab Sample ID: 480-192850-1

Date Collected: 11/23/21 10:04

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 14:16	CRL	TAL BUF
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 02:00	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 21:13	LMH	TAL BUF

Client Sample ID: MW-1

Lab Sample ID: 480-192850-2

Date Collected: 11/26/21 08:14

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 14:38	CRL	TAL BUF
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 02:04	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 21:17	LMH	TAL BUF

Client Sample ID: MW-11

Lab Sample ID: 480-192850-3

Date Collected: 11/23/21 14:31

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 15:00	CRL	TAL BUF
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 02:08	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 21:21	LMH	TAL BUF

Client Sample ID: MW-12

Lab Sample ID: 480-192850-4

Date Collected: 11/23/21 10:42

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 15:22	CRL	TAL BUF
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 02:37	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 21:50	LMH	TAL BUF

Client Sample ID: MW-13

Lab Sample ID: 480-192850-5

Date Collected: 11/24/21 09:29

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 15:44	CRL	TAL BUF

Eurofins TestAmerica, Buffalo

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-13

Lab Sample ID: 480-192850-5

Date Collected: 11/24/21 09:29

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 02:41	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 21:54	LMH	TAL BUF

Client Sample ID: MW-14

Lab Sample ID: 480-192850-6

Date Collected: 11/24/21 08:28

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 16:06	CRL	TAL BUF
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 02:45	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 21:58	LMH	TAL BUF

Client Sample ID: MW-1DA

Lab Sample ID: 480-192850-7

Date Collected: 11/24/21 13:05

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 16:28	CRL	TAL BUF
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 02:49	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 22:01	LMH	TAL BUF

Client Sample ID: MW-2A

Lab Sample ID: 480-192850-8

Date Collected: 11/23/21 11:22

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 16:50	CRL	TAL BUF
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 02:52	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 22:05	LMH	TAL BUF

Client Sample ID: MW-3

Lab Sample ID: 480-192850-9

Date Collected: 11/23/21 13:43

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 17:12	CRL	TAL BUF

Eurofins TestAmerica, Buffalo

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-3

Date Collected: 11/23/21 13:43

Date Received: 11/26/21 12:45

Lab Sample ID: 480-192850-9

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 02:56	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 22:09	LMH	TAL BUF

Client Sample ID: MW-5

Date Collected: 11/23/21 14:35

Date Received: 11/26/21 12:45

Lab Sample ID: 480-192850-10

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 17:34	CRL	TAL BUF
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 03:00	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 22:12	LMH	TAL BUF

Client Sample ID: MW-6A

Date Collected: 11/23/21 10:04

Date Received: 11/26/21 12:45

Lab Sample ID: 480-192850-11

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 17:56	CRL	TAL BUF
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 03:04	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 22:16	LMH	TAL BUF

Client Sample ID: MW-6DA

Date Collected: 11/23/21 09:20

Date Received: 11/26/21 12:45

Lab Sample ID: 480-192850-12

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 18:18	CRL	TAL BUF
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 03:18	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 22:31	LMH	TAL BUF

Client Sample ID: MW-7

Date Collected: 11/23/21 12:44

Date Received: 11/26/21 12:45

Lab Sample ID: 480-192850-13

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 18:40	CRL	TAL BUF

Eurofins TestAmerica, Buffalo

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Client Sample ID: MW-7

Lab Sample ID: 480-192850-13

Date Collected: 11/23/21 12:44

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 03:22	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 22:35	LMH	TAL BUF

Client Sample ID: MW-9

Lab Sample ID: 480-192850-14

Date Collected: 11/26/21 09:20

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 19:03	CRL	TAL BUF
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 03:26	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 22:39	LMH	TAL BUF

Client Sample ID: MW-9D

Lab Sample ID: 480-192850-15

Date Collected: 11/26/21 10:50

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 19:24	CRL	TAL BUF
Dissolved	Prep	3005A			606948	11/30/21 09:35	ADM	TAL BUF
Dissolved	Analysis	6010C		1	607329	12/02/21 03:30	AMH	TAL BUF
Total/NA	Prep	3005A			606944	11/30/21 09:37	ADM	TAL BUF
Total/NA	Analysis	6010C		1	607220	11/30/21 22:42	LMH	TAL BUF

Client Sample ID: TRIP BLANK

Lab Sample ID: 480-192850-16

Date Collected: 11/23/21 10:30

Matrix: Ground Water

Date Received: 11/26/21 12:45

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	607001	11/30/21 19:47	CRL	TAL BUF

Laboratory References:

TAL BUF = Eurofins TestAmerica, Buffalo, 10 Hazelwood Drive, Amherst, NY 14228-2298, TEL (716)691-2600

Accreditation/Certification Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Laboratory: Eurofins TestAmerica, Buffalo

Unless otherwise noted, all analytes for this laboratory were covered under each accreditation/certification below.

Authority	Program	Identification Number	Expiration Date
New York	NELAP	10026	04-01-22

The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.

Analysis Method	Prep Method	Matrix	Analyte
8260C		Ground Water	1,2-Dichloroethene, Total

Method Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Method	Method Description	Protocol	Laboratory
8260C	Volatile Organic Compounds by GC/MS	SW846	TAL BUF
6010C	Metals (ICP)	SW846	TAL BUF
3005A	Preparation, Total Metals	SW846	TAL BUF
3005A	Preparation, Total Recoverable or Dissolved Metals	SW846	TAL BUF
5030C	Purge and Trap	SW846	TAL BUF

Protocol References:

SW846 = "Test Methods For Evaluating Solid Waste, Physical/Chemical Methods", Third Edition, November 1986 And Its Updates.

Laboratory References:

TAL BUF = Eurofins TestAmerica, Buffalo, 10 Hazelwood Drive, Amherst, NY 14228-2298, TEL (716)691-2600

Sample Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

Lab Sample ID	Client Sample ID	Matrix	Collected	Received
480-192850-1	Dup	Ground Water	11/23/21 10:04	11/26/21 12:45
480-192850-2	MW-1	Ground Water	11/26/21 08:14	11/26/21 12:45
480-192850-3	MW-11	Ground Water	11/23/21 14:31	11/26/21 12:45
480-192850-4	MW-12	Ground Water	11/23/21 10:42	11/26/21 12:45
480-192850-5	MW-13	Ground Water	11/24/21 09:29	11/26/21 12:45
480-192850-6	MW-14	Ground Water	11/24/21 08:28	11/26/21 12:45
480-192850-7	MW-1DA	Ground Water	11/24/21 13:05	11/26/21 12:45
480-192850-8	MW-2A	Ground Water	11/23/21 11:22	11/26/21 12:45
480-192850-9	MW-3	Ground Water	11/23/21 13:43	11/26/21 12:45
480-192850-10	MW-5	Ground Water	11/23/21 14:35	11/26/21 12:45
480-192850-11	MW-6A	Ground Water	11/23/21 10:04	11/26/21 12:45
480-192850-12	MW-6DA	Ground Water	11/23/21 09:20	11/26/21 12:45
480-192850-13	MW-7	Ground Water	11/23/21 12:44	11/26/21 12:45
480-192850-14	MW-9	Ground Water	11/26/21 09:20	11/26/21 12:45
480-192850-15	MW-9D	Ground Water	11/26/21 10:50	11/26/21 12:45
480-192850-16	TRIP BLANK	Ground Water	11/23/21 10:30	11/26/21 12:45

Quantitation Limit Exceptions Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-192850-1

The requested project specific reporting limits listed below were less than laboratory standard quantitation limits (PQL) but greater than or equal to the laboratory method detection limits (MDL). It must be noted that results reported below lab standard quantitation limits may result in false positive/false negative values and less accurate quantitation. Routine laboratory procedures do not indicate corrective action for detections below the laboratory's PQL.

Method	Analyte	Matrix	Prep Type	Unit	Client RL	Lab PQL
6010C	Lead	Ground Water	Total/NA	ug/L	3.0	10
6010C	Lead, Dissolved	Ground Water	Dissolved	ug/L	3.0	10

Chain of Custody Record

Environment Testing
America

Client Information		Sampler: ART KOSKE		Lab PM: Fischer, Brian J		Carrier Tracking No(s): 480-167983-19331.1		COC No: 480-167983-19331.1	
Client Contact: Patrick Allenstein		Phone:		E-Mail: Brian.Fischer@Eurofinset.com		State of Origin: NY		Page: Page 1 of 2	
Company: KPRG and Associates, Inc.		PWSID:		Analysis Requested		Job #:		Preservation Codes:	
Address: 14665 West Lisbon Road, Suite 1A		Due Date Requested:		8260C - (MOD) Local Method		6010C - T. Cd/Cr/Pb (ICP)		6010C - D. Cd/Cr/Pb (ICP)	
City: Brookfield		TAT Requested (days):		Field Filtered Sample (Yes or No)		Permeth MS/MSD (Yes or No)		Total Number of	
State, Zip: WI, 53005		Compliance Project: ☒ Yes ☐ No		Sample Date		Sample Time		Sample Type (C=Comp, G=grab)	
Phone: 262-781-0475(Tel)		PO #: Purchase Order not required		Matrix (W=water, S=solid, O=overhead)		Preservation Code:		Special Instructions/Note:	
Email: patricka@kprginc.com		WO #:		MW-1		11-26-21 8:14		G	
Project Name: Prestolite site/ Event Desc: Prestolite site		Project #: 48002774		MW-11		11-23-21 14:31		Water	
Site: New York		SSOW#:		MW-12		11-23-21 10:42		Water	
				MW-13		11-24-21 9:29		Water	
				MW-14		11-24-21 8:28		Water	
				MW-1DA		11-24-21 13:05		Water	
				MW-2A		11-23-21 11:22		Water	
				MW-3		11-23-21 13:43		Water	
				MW-5		11-23-21 14:35		Water	
				MW-6A		11-23-21 10:04		Water	
				MW-6DA		11-23-21 9:20		Water	
Possible Hazard Identification		☒ Non-Hazard ☐ Flammable ☐ Skin Irritant ☐ Poison B ☐ Unknown ☐ Radiological		Sample Disposal (A fee may be assessed if samples are retained longer than 1 month)		☐ Return To Client ☒ Disposal By Lab		Archive For Months	
Relinquished by: <i>Art Koske</i>		Date: 11-26-21 1245		Company: 5533		Received by: <i>Art Koske</i>		Date/Time: 11/26/21 1245	
Relinquished by:		Date/Time:		Company:		Received by:		Date/Time:	
Relinquished by:		Date/Time:		Company:		Received by:		Date/Time:	
Custody Seals Intact: ☐ Yes ☐ No		Custody Seal No.:		Cooler Temperature(s) °C and Other Remarks: 3.7 #1		Method of Shipment:		Company: TA	

Chain of Custody Record

Environment Testing
America

Client Information		Sampler: ART KOSKE		Lab PM: Fischer, Brian J		Carrier Tracking No(s):		COC No: 480-167983-19331.2	
Client Contact: Patrick Allenstein		Phone:		E-Mail: Brian.Fischer@Eurofins.com		State of Origin: NY		Page: 2 of 2	
Company: KPRG and Associates, Inc.		PWSID:		Analysis Requested		Job #:		Preservation Codes:	
Address: 14665 West Lisbon Road, Suite 1A		Due Date Requested:		Field Filtered Sample (Yes or No)		8260C - (MOD) Local Method		6010C - T. Cd/Cr/Pb (ICP)	
City: Brookfield		TAT Requested (days): PER CONTRACT		Perform MS/MSD (Yes or No)		6010C - D. Cd/Cr/Pb (ICP)		Total Number of Containers	
State, Zip: WI, 53005		Compliance Project: Yes No		Matrix (W=Water, S=Soil, O=Overseal)		6010C - D. Cd/Cr/Pb (ICP)		Special Instructions/Note:	
Phone: 262-781-0475(Tel)		PO #: Purchase Order not required		Sample Type (C=Comp, G=grab)		6010C - T. Cd/Cr/Pb (ICP)		5 DISSOLVED METALS	
Email: patricka@kprginc.com		WO #: Project Name:		Sample Time		6010C - D. Cd/Cr/Pb (ICP)		5 ARE FILLED	
Project Name: Prestolite site/ Event Desc: Prestolite site		Project #: 48002774		Sample Date		6010C - T. Cd/Cr/Pb (ICP)		5 FILTERED	
Site: New York		SSOW#:		Preservation Code:		6010C - D. Cd/Cr/Pb (ICP)		3	
Sample Identification		Sample Date		Sample Time		6010C - T. Cd/Cr/Pb (ICP)		5	
MW-7	11-23-21	12:14	Water			6010C - D. Cd/Cr/Pb (ICP)		5	
MW-9	11-26-21	9:20	Water			6010C - T. Cd/Cr/Pb (ICP)		5	
MW-9D	11-26-21	10:50	Water			6010C - D. Cd/Cr/Pb (ICP)		5	
TRIP BLANK	11-23-21	10:30	Water			6010C - T. Cd/Cr/Pb (ICP)		3	
Dup	11-23-21	10:04	Water			6010C - D. Cd/Cr/Pb (ICP)		5	
MS	11-23-21	14:31	Water			6010C - T. Cd/Cr/Pb (ICP)		5	
MSD	11-23-21	14:31	Water			6010C - D. Cd/Cr/Pb (ICP)		5	
			Water			6010C - T. Cd/Cr/Pb (ICP)			
			Water			6010C - D. Cd/Cr/Pb (ICP)			
Possible Hazard Identification		Flammable		Skin Irritant		Poison B		Unknown	
Deliverable Requested: I, II, III, IV, Other (specify)		Radiological		Sample Disposal (A fee may be assessed if samples are retained longer than 1 month)		Return To Client		Archive For	
Empty Kit Relinquished by:		Date:		Time:		Special Instructions/QC Requirements:		Months	
Relinquished by:		Date/Time: 11-26-21 12:45		Company: 553		Received by:		Date/Time: 11/26/21 12:45	
Relinquished by:		Date/Time:		Company:		Received by:		Date/Time:	
Relinquished by:		Date/Time:		Company:		Received by:		Date/Time:	
Custody Seal's Intact: Yes No		Custody Seal No.:		Cooler Temperature(s) °C and Other Remarks:					

Login Sample Receipt Checklist

Client: KPRG and Associates, Inc.

Job Number: 480-192850-1

Login Number: 192850

List Source: Eurofins TestAmerica, Buffalo

List Number: 1

Creator: Sabuda, Brendan D

Question	Answer	Comment
Radioactivity either was not measured or, if measured, is at or below background	True	
The cooler's custody seal, if present, is intact.	True	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	True	
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	True	3.7 #1 ICE
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the sample IDs on the containers and the COC.	True	
Samples are received within Holding Time (Excluding tests with immediate HTs)..	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified	True	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
VOA sample vials do not have headspace or bubble is <6mm (1/4") in diameter.	True	
If necessary, staff have been informed of any short hold time or quick TAT needs	True	
Multiphasic samples are not present.	True	
Samples do not require splitting or compositing.	True	
Sampling Company provided.	True	
Samples received within 48 hours of sampling.	True	
Samples requiring field filtration have been filtered in the field.	True	
Chlorine Residual checked.	True	



Well Purging and Sample Collection

Project No.: _____ Well No. MW-9D Site: PRESTOLITE

Purging Method: Pumped ☒ Bailed ☐ Other: _____

Pump Type: _____ Bailer Type: 2"

Weather Conditions: FLURRIES 30°

Volume Calculation: _____

(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)
(Gals./well vol. x 5 = Total Volume to be removed)

Gals./well vol.: 5.2 / 15.7

Time	Depth to Water (D.T.W.)	Depth to Bottom (D.T.B.)	Volume Removed (gal.)	pH	Cond.	Temp.	Color	Odor Y/N	Turbidity
9:36	10.74	43.35	7.86		543	54	TAN	NO	OPAQUE
9:44			7.97	25	522	57	LT TAN	NO	TRANSLUCENT
9:50			8.04	5	515	60	LT TAN	NO	TRANSLUCENT
9:56			8.06	7.5	529	59	LT TAN	NO	TRANSLUCENT
10:01			7.94	10	532	59	LT TAN	NO	TRANSLUCENT
10:07			7.90	12.5	530	58	LT TAN	NO	TRANSLUCENT
10:12			7.91	15	519	58	LT TAN	NO	OPAQUE
10:21			8.02	17.5	520	58	LT TAN	NO	OPAQUE
10:28			8.02	19	519	58	LT TAN	NO	OPAQUE
			BAILED	DRY	SLOW TO RECOVER				
		Sample Readings	10:50	SAMPLED					

Comments: WELL IN GOOD CONDITION

Inside Diameter	vol./ft.
1"	0.04
1.25"	0.06
2"	0.16
4"	0.65

Field Blank Taken ☐ Time: _____

Well Duplicate ☐ No.: _____

Signature: [Signature]

Date: 11 / 26 / 21

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	

Well Purging and Sample Collection

Project No.: _____

Well No. MW-9

Site: PRESTON LITE

Purging Method:

Pumped

☒ Bailed☐ Other:

Pump Type:

Bailer Type: Z¹

Weather Conditions:

FLURRIES 30°

Volume Calculation:

$$(\text{D.T.B.} - \text{D.T.W.} \times \text{vol./fl.} = \text{Gals./well vol.})$$

Gals./well vol.: 1.6 / 4.9

(Gals./well vol. x 5 = Total Volume to be removed).

Time	Depth to Water (D.T.W.)	Depth to Bottom (D.T.B.)	Volume Removed (gal.)	pH	Cond.	Temp.	Color	Odor Y/N	Turbidity
8:51	11.67	21.95		7.52	742	42	DRK BROWN	NO	OPAQUE
8:54			7.73	1	619	54	BROWN	NO	OPAQUE
8:59			7.69	2	611	57	LT BROWN	NO	OPAQUE
9:03			7.78	3	610	57	LT BROWN	NO	OPAQUE
9:08			7.66	4	598	57	LT BROWN	NO	OPAQUE
9:11			7.80	5	604	57	TAN	NO	OPAQUE
9:15			7.82	6	604	57	TAN	NO	OPAQUE
9:20			7.83	7	600	57	TAN	NO	OPAQUE
		Sample Readings							

Comments: WELL IN GOOD CONDITION

Inside Diameter	vol./ft.
1"	0.04
1.25"	0.06
2"	0.16
4"	0.65

Field Blank Taken ☐ Time:

Well Duplicate ☒ No.:

Signature: _____

Date:

11, 26, 24

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Well Purging and Sample Collection

Project No.: _____ Well No. MW-1 Site: PRESTOLITE

Purging Method: Pumped ☒ Bailed ☐ Other: _____

Pump Type: _____ Bailer Type: 2'

Weather Conditions: _____

Volume Calculation: FLURRIES 30°

(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)
(Gals./well vol. x 5 = Total Volume to be removed) Gals./well vol.: 1.0 / 2.9

Time	Depth to Water (D.T.W.)	Depth to Bottom (D.T.B.)	Volume Removed (gal.)	pH	Cond.	Temp.	Color	Odor Y/N	Turbidity
7:42	11.89	18.0		8.33	845	47	BROWN	NO	OPAQUE
7:45			1/2	7.98	820	53	TAN	NO	OPAQUE
7:48			1	7.92	818	53	LT TAN	NO	OPAQUE
7:51			1 1/2	7.88	822	53	LT TAN	NO	OPAQUE
7:55			2	7.87	800	53	LT TAN	NO	TRANSLUCENT
7:58			2 1/2	7.84	803	53	LT TAN	NO	TRANSPARENT
8:01			3	7.84	816	53	LT TAN	NO	TRANSPARENT
8:04			3 1/2	7.71	808	53	LT TAN	NO	OPAQUE
8:07			4	7.84	806	53	LT TAN	NO	OPAQUE
8:11			4 1/2	7.83	798	53	LT TAN	NO	OPAQUE
8:14			Sample Readings 5	7.81	805	53	LT TAN	NO	TRANSPARENT

Comments: WELL IN GOOD CONDITION

Inside Diameter	vol./ft.
1"	0.04
1.25"	0.06
2"	0.16
4"	0.65


Field Blank Taken ☐ Time: _____

Well Duplicate ☐ No.: _____

Signature: [Signature]

Date: 11/26/21

HNu/PPM	LEL/%	O2/%	H2S/PPM	CO/PPM	



HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Well Purging and Sample Collection

Project No.: _____ Well No. MW-3 Site: PRESTOLITE

Purging Method: Pumped ☒ Bailed ☐ Other: _____

Pump Type: _____ Bailer Type: 2"

Weather Conditions: P/Cloudy 36°

Volume Calculation: _____

(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)

(Gals./well vol. x 5 = Total Volume to be removed)

Gals./well vol.: 1.1 / 3.3

Time	Depth to Water (D.T.W.)	Depth to Bottom (D.T.B.)	Volume Removed (gal.)	pH	Cond.	Temp.	Color	Odor Y/N	Turbidity
13:22	7.53	14.45		7.19	583	48	TAN	NO	OPAQUE
13:24			.5	7.47	595	52	LT TAN	NO	TRANSPARENT
13:27			1	7.51	600	52	CLEAR	NO	CLEAR
13:29			1.5	7.55	593	53	CLEAR	NO	CLEAR
13:31			2	7.57	593	52	CLEAR	NO	CLEAR
13:34			2.5	7.68	598	52	CLEAR	NO	CLEAR
13:37			3	7.61	593	52	CLEAR	NO	CLEAR
13:39			3.5	7.59	597	52	CLEAR	NO	CLEAR
13:41			4	7.66	600	52	CLEAR	NO	CLEAR
13:43			4 1/2	7.60	597	52	CLEAR	NO	CLEAR
Sample Readings									

Comments: WELL IN GOOD CONDITION

Inside Diameter	vol./ft.
1"	0.04
1.25"	0.06
2"	0.16
4"	0.65

Field Blank Taken ☐ Time: _____

Well Duplicate ☐ No.: _____

Signature: [Signature]

Date: 11/23/21

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Well Purging and Sample Collection

Project No.: _____ Well No. MW-2A Site: PRESTOLITE

Purging Method: Pumped ☒ Bailed ☐ Other: _____

Pump Type: _____ Bailer Type: 2"

Weather Conditions: 30° P/SUNNY

Volume Calculation: _____

(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)

(Gals./well vol. x 5 = Total Volume to be removed)

Gals./well vol.: 0.4 / 1.3

Time	Depth to Water (D.T.W.)	Depth to Bottom (D.T.B.)	Volume Removed (gal.)	pH	Cond.	Temp.	Color	Odor Y/N	Turbidity
11:01	16.86	19.6		8.16	452	46	TAN	NO	TRANSPARENT
11:03			.25	7.93	461	50	CLEAR	NO	CLEAR
11:05			.5	7.76	490	50	CLEAR	NO	CLEAR
11:07			.75	7.61	513	50	CLEAR	NO	CLEAR
11:09			1	7.49	526	50	CLEAR	NO	CLEAR
11:11			1.25	7.57	534	50	CLEAR	NO	CLEAR
11:13			1.5	7.51	539	50	CLEAR	NO	CLEAR
11:15			1.75	7.47	542	50	CLEAR	NO	CLEAR
11:18			2	7.57	545	50	CLEAR	NO	CLEAR
11:20			2.25	7.41	552	51	CLEAR	NO	CLEAR
11:22			Sample Readings 2.5		7.39	556	50	CLEAR	NO CLEAR

Comments: WELL IN GOOD CONDITION

Inside Diameter	vol./ft.
1"	0.04
1.25"	0.06
2"	0.16
4"	0.65

Field Blank Taken ☐ Time: _____

Well Duplicate ☐ No.: _____

Signature: [Signature]

Date: 11/23/21

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Well Purging and Sample Collection

Project No.: _____ Well No. MW-6A Site: PRESTOLITE

Purging Method: Pumped ☒ Bailed ☐ Other: _____

Pump Type: _____ Bailer Type: 2"

Weather Conditions: CLOUDY 27°

Volume Calculation: _____

(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)

(Gals./well vol. x 5 = Total Volume to be removed)

Gals./well vol.: 7 / 2.2

Time	Depth to Water (D.T.W.)	Depth to Bottom (D.T.B.)	Volume Removed (gal.)	pH	Cond.	Temp.	Color	Odor Y/N	Turbidity
9:36	17.42	22.05		7.98	555	44	TAN	NO	OPAQUE
9:39			1/2	7.93	591	50	CLEAR	NO	CLEAR
9:41			1	7.86	596	52	CLEAR	NO	CLEAR
9:44			1 1/2	7.90	588	52	CLEAR	NO	CLEAR
9:47			2	7.82	594	52	CLEAR	NO	CLEAR
9:50			2 1/2	7.88	579	52	CLEAR	NO	CLEAR
9:52			3	7.81	596	52	CLEAR	NO	CLEAR
9:56			3 1/2	7.86	600	52	CLEAR	NO	CLEAR
9:58			4	7.84	589	52	CLEAR	NO	CLEAR
10:01			4 1/2	7.84	600	52	CLEAR	NO	CLEAR
10:04			Sample Readings 5	7.85	591	52	CLEAR	NO	CLEAR

Comments: WELL IN GOOD CONDITION

TOOK DUP SAMPLE

Inside Diameter	vol./ft.
1"	0.04
1.25"	0.06
2"	0.16
4"	0.65


Field Blank Taken ☐ Time: _____

Well Duplicate ☒ No.: DUP

Signature: [Signature]

Date: 11/23/21

HNu/PPM	LEL/%	O2/%	H2S/PPM	CO/PPM	



Gals./well vol.: 7.5 / 22.6

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	

ANALYTICAL REPORT

Eurofins Buffalo
10 Hazelwood Drive
Amherst, NY 14228-2298
Tel: (716)691-2600

Laboratory Job ID: 480-198760-1
Client Project/Site: Prestolite site
Sampling Event: Prestolite site

For:
KPRG and Associates, Inc.
14665 West Lisbon Road,
Suite 1A
Brookfield, Wisconsin 53005

Attn: Mr. Rich Gnat



Authorized for release by:

6/16/2022 3:40:59 PM

Rebecca Jones, Project Management Assistant I
Rebecca.Jones@et.eurofinsus.com

Designee for

Brian Fischer, Manager of Project Management
(716)504-9835
Brian.Fischer@et.eurofinsus.com

LINKS

Review your project
results through



Have a Question?



Visit us at:

www.eurofinsus.com/Env

The test results in this report meet all 2003 NELAC, 2009 TNI, and 2016 TNI requirements for accredited parameters, exceptions are noted in this report. This report may not be reproduced except in full, and with written approval from the laboratory. For questions please contact the Project Manager at the e-mail address or telephone number listed on this page.

This report has been electronically signed and authorized by the signatory. Electronic signature is intended to be the legally binding equivalent of a traditionally handwritten signature.

Results relate only to the items tested and the sample(s) as received by the laboratory.

Table of Contents

Cover Page 1

Table of Contents 2

Definitions/Glossary 3

Case Narrative 4

Detection Summary 5

Client Sample Results 7

Surrogate Summary 23

QC Sample Results 24

QC Association Summary 31

Lab Chronicle 34

Certification Summary 38

Method Summary 39

Sample Summary 40

Detection Limit Exceptions Summary 41

Chain of Custody 42

Receipt Checklists 44



Definitions/Glossary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Qualifiers

GC/MS VOA

Qualifier	Qualifier Description
*+	LCS and/or LCSD is outside acceptance limits, high biased.
F1	MS and/or MSD recovery exceeds control limits.
J	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.
U	Indicates the analyte was analyzed for but not detected.

Metals

Qualifier	Qualifier Description
U	Indicates the analyte was analyzed for but not detected.

Glossary

Abbreviation	These commonly used abbreviations may or may not be present in this report.
α	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CFL	Contains Free Liquid
CFU	Colony Forming Unit
CNF	Contains No Free Liquid
DER	Duplicate Error Ratio (normalized absolute difference)
Dil Fac	Dilution Factor
DL	Detection Limit (DoD/DOE)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision Level Concentration (Radiochemistry)
EDL	Estimated Detection Limit (Dioxin)
LOD	Limit of Detection (DoD/DOE)
LOQ	Limit of Quantitation (DoD/DOE)
MCL	EPA recommended "Maximum Contaminant Level"
MDA	Minimum Detectable Activity (Radiochemistry)
MDC	Minimum Detectable Concentration (Radiochemistry)
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
MPN	Most Probable Number
MQL	Method Quantitation Limit
NC	Not Calculated
ND	Not Detected at the reporting limit (or MDL or EDL if shown)
NEG	Negative / Absent
POS	Positive / Present
PQL	Practical Quantitation Limit
PRES	Presumptive
QC	Quality Control
RER	Relative Error Ratio (Radiochemistry)
RL	Reporting Limit or Requested Limit (Radiochemistry)
RPD	Relative Percent Difference, a measure of the relative difference between two points
TEF	Toxicity Equivalent Factor (Dioxin)
TEQ	Toxicity Equivalent Quotient (Dioxin)
TNTC	Too Numerous To Count

Case Narrative

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Job ID: 480-198760-1

Laboratory: Eurofins Buffalo

Narrative

Job Narrative 480-198760-1

Comments

No additional comments.

Receipt

The samples were received on 6/7/2022 11:20 AM. Unless otherwise noted below, the samples arrived in good condition, and where required, properly preserved and on ice. The temperatures of the 2 coolers at receipt time were 3.4° C and 4.1° C.

GC/MS VOA

Method 8260C: Due to the coelution of Ethyl Acetate with 2-Butanone in the full spike solution, these analytes exceeded control limits in the laboratory control sample (LCS) and/or laboratory control sample duplicate (LCSD) associated with batch 629695. The following samples were affected : MW-12 (480-198760-4), MW-13 (480-198760-5), MW-1DA (480-198760-7), MW-9 (480-198760-14) and MW-9D (480-198760-15).

Method 8260C: Due to the coelution of Ethyl Acetate with 2-Butanone in the full spike solution, these analytes exceeded control limits in the laboratory control sample (LCS) and/or laboratory control sample duplicate (LCSD) associated with batch 629936. The following samples were affected : MW-11 (480-198760-3), MW-14 (480-198760-6), MW-2A (480-198760-8), MW-3 (480-198760-9), MW-5 (480-198760-10), MW-6A (480-198760-11), MW-6DA (480-198760-12), MW-7 (480-198760-13) and TRIP BLANK (480-198760-16).

No additional analytical or quality issues were noted, other than those described above or in the Definitions/Glossary page.

Metals

No analytical or quality issues were noted, other than those described in the Definitions/Glossary page.

Detection Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: Dup

Lab Sample ID: 480-198760-1

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	10		10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-1

Lab Sample ID: 480-198760-2

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	11	F1	10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-11

Lab Sample ID: 480-198760-3

No Detections.

Client Sample ID: MW-12

Lab Sample ID: 480-198760-4

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	10		10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-13

Lab Sample ID: 480-198760-5

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	1.0	J	10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-14

Lab Sample ID: 480-198760-6

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Chromium	27.4		10.0		ug/L	1		6010C	Total/NA
Lead	23.1		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: MW-1DA

Lab Sample ID: 480-198760-7

No Detections.

Client Sample ID: MW-2A

Lab Sample ID: 480-198760-8

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Acetone	3.7	J	10	3.0	ug/L	1		8260C	Total/NA
Trichloroethene	1.9	J	10	0.46	ug/L	1		8260C	Total/NA
1,2-Dichloroethene, Total	2.9	J	10	0.81	ug/L	1		8260C	Total/NA

Client Sample ID: MW-3

Lab Sample ID: 480-198760-9

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	0.76	J	10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-5

Lab Sample ID: 480-198760-10

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Chromium	17.1		10.0		ug/L	1		6010C	Total/NA
Lead	13.4		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: MW-6A

Lab Sample ID: 480-198760-11

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	18		10	0.46	ug/L	1		8260C	Total/NA

This Detection Summary does not include radiochemical test results.

Eurofins Buffalo

Detection Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-6DA

Lab Sample ID: 480-198760-12

Analyte	Result	Qualifier	RL	MDL	Unit	Dil	Fac	D	Method	Prep Type
Lead	15.5		3.0		ug/L		1		6010C	Total/NA

Client Sample ID: MW-7

Lab Sample ID: 480-198760-13

No Detections.

Client Sample ID: MW-9

Lab Sample ID: 480-198760-14

Analyte	Result	Qualifier	RL	MDL	Unit	Dil	Fac	D	Method	Prep Type
Trichloroethene	6.5	J	10	0.46	ug/L		1		8260C	Total/NA
1,2-Dichloroethene, Total	0.83	J	10	0.81	ug/L		1		8260C	Total/NA
Lead	14.2		3.0		ug/L		1		6010C	Total/NA

Client Sample ID: MW-9D

Lab Sample ID: 480-198760-15

Analyte	Result	Qualifier	RL	MDL	Unit	Dil	Fac	D	Method	Prep Type
Lead	11.4		3.0		ug/L		1		6010C	Total/NA

Client Sample ID: TRIP BLANK

Lab Sample ID: 480-198760-16

No Detections.

This Detection Summary does not include radiochemical test results.

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: Dup

Date Collected: 06/03/22 09:27

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-1

Matrix: Ground Water

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/11/22 20:40	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/11/22 20:40	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/11/22 20:40	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/11/22 20:40	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/11/22 20:40	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/11/22 20:40	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/11/22 20:40	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			06/11/22 20:40	1
2-Hexanone	10	U	10	1.2	ug/L			06/11/22 20:40	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/11/22 20:40	1
Acetone	10	U	10	3.0	ug/L			06/11/22 20:40	1
Benzene	10	U	10	0.41	ug/L			06/11/22 20:40	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/11/22 20:40	1
Bromoform	10	U	10	0.26	ug/L			06/11/22 20:40	1
Bromomethane	10	U	10	0.69	ug/L			06/11/22 20:40	1
Carbon disulfide	10	U	10	0.19	ug/L			06/11/22 20:40	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/11/22 20:40	1
Chlorobenzene	10	U	10	0.75	ug/L			06/11/22 20:40	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/11/22 20:40	1
Chloroethane	10	U	10	0.32	ug/L			06/11/22 20:40	1
Chloroform	10	U	10	0.34	ug/L			06/11/22 20:40	1
Chloromethane	10	U	10	0.35	ug/L			06/11/22 20:40	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/11/22 20:40	1
Ethylbenzene	10	U	10	0.74	ug/L			06/11/22 20:40	1
Methylene Chloride	10	U	10	0.44	ug/L			06/11/22 20:40	1
Styrene	10	U	10	0.73	ug/L			06/11/22 20:40	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/11/22 20:40	1
Toluene	10	U	10	0.51	ug/L			06/11/22 20:40	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/11/22 20:40	1
Trichloroethene	10		10	0.46	ug/L			06/11/22 20:40	1
Vinyl chloride	10	U	10	0.90	ug/L			06/11/22 20:40	1
Xylenes, Total	10	U	10	0.66	ug/L			06/11/22 20:40	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/11/22 20:40	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	102		77 - 120		06/11/22 20:40	1
Toluene-d8 (Surr)	94		80 - 120		06/11/22 20:40	1
4-Bromofluorobenzene (Surr)	104		73 - 120		06/11/22 20:40	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 15:49	1
Chromium	10.0	U	10.0		ug/L		06/10/22 08:52	06/10/22 15:49	1
Lead	3.0	U	3.0		ug/L		06/10/22 08:52	06/10/22 15:49	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/09/22 23:42	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/09/22 23:42	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/09/22 23:42	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-1

Lab Sample ID: 480-198760-2

Date Collected: 06/03/22 10:30

Matrix: Ground Water

Date Received: 06/07/22 11:20

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/11/22 21:02	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/11/22 21:02	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/11/22 21:02	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/11/22 21:02	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/11/22 21:02	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/11/22 21:02	1
1,2-Dichloropropane	10	F1 U	10	0.72	ug/L			06/11/22 21:02	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			06/11/22 21:02	1
2-Hexanone	10	U	10	1.2	ug/L			06/11/22 21:02	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/11/22 21:02	1
Acetone	10	U	10	3.0	ug/L			06/11/22 21:02	1
Benzene	10	U	10	0.41	ug/L			06/11/22 21:02	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/11/22 21:02	1
Bromoform	10	U	10	0.26	ug/L			06/11/22 21:02	1
Bromomethane	10	U	10	0.69	ug/L			06/11/22 21:02	1
Carbon disulfide	10	U	10	0.19	ug/L			06/11/22 21:02	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/11/22 21:02	1
Chlorobenzene	10	U	10	0.75	ug/L			06/11/22 21:02	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/11/22 21:02	1
Chloroethane	10	U	10	0.32	ug/L			06/11/22 21:02	1
Chloroform	10	U	10	0.34	ug/L			06/11/22 21:02	1
Chloromethane	10	U	10	0.35	ug/L			06/11/22 21:02	1
cis-1,3-Dichloropropene	10	F1 U	10	0.36	ug/L			06/11/22 21:02	1
Ethylbenzene	10	U	10	0.74	ug/L			06/11/22 21:02	1
Methylene Chloride	10	U	10	0.44	ug/L			06/11/22 21:02	1
Styrene	10	U	10	0.73	ug/L			06/11/22 21:02	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/11/22 21:02	1
Toluene	10	U	10	0.51	ug/L			06/11/22 21:02	1
trans-1,3-Dichloropropene	10	F1 U	10	0.37	ug/L			06/11/22 21:02	1
Trichloroethene	11	F1	10	0.46	ug/L			06/11/22 21:02	1
Vinyl chloride	10	U	10	0.90	ug/L			06/11/22 21:02	1
Xylenes, Total	10	U	10	0.66	ug/L			06/11/22 21:02	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/11/22 21:02	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	103		77 - 120		06/11/22 21:02	1
Toluene-d8 (Surr)	95		80 - 120		06/11/22 21:02	1
4-Bromofluorobenzene (Surr)	103		73 - 120		06/11/22 21:02	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 15:53	1
Chromium	10.0	U	10.0		ug/L		06/10/22 08:52	06/10/22 15:53	1
Lead	3.0	U	3.0		ug/L		06/10/22 08:52	06/10/22 15:53	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/09/22 23:46	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/09/22 23:46	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/09/22 23:46	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-11

Lab Sample ID: 480-198760-3

Date Collected: 06/06/22 09:53

Matrix: Ground Water

Date Received: 06/07/22 11:20

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/14/22 18:31	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/14/22 18:31	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/14/22 18:31	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/14/22 18:31	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/14/22 18:31	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/14/22 18:31	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/14/22 18:31	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/14/22 18:31	1
2-Hexanone	10	U	10	1.2	ug/L			06/14/22 18:31	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/14/22 18:31	1
Acetone	10	U	10	3.0	ug/L			06/14/22 18:31	1
Benzene	10	U	10	0.41	ug/L			06/14/22 18:31	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/14/22 18:31	1
Bromoform	10	U	10	0.26	ug/L			06/14/22 18:31	1
Bromomethane	10	U	10	0.69	ug/L			06/14/22 18:31	1
Carbon disulfide	10	U	10	0.19	ug/L			06/14/22 18:31	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/14/22 18:31	1
Chlorobenzene	10	U	10	0.75	ug/L			06/14/22 18:31	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/14/22 18:31	1
Chloroethane	10	U	10	0.32	ug/L			06/14/22 18:31	1
Chloroform	10	U	10	0.34	ug/L			06/14/22 18:31	1
Chloromethane	10	U	10	0.35	ug/L			06/14/22 18:31	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/14/22 18:31	1
Ethylbenzene	10	U	10	0.74	ug/L			06/14/22 18:31	1
Methylene Chloride	10	U	10	0.44	ug/L			06/14/22 18:31	1
Styrene	10	U	10	0.73	ug/L			06/14/22 18:31	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/14/22 18:31	1
Toluene	10	U	10	0.51	ug/L			06/14/22 18:31	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/14/22 18:31	1
Trichloroethene	10	U	10	0.46	ug/L			06/14/22 18:31	1
Vinyl chloride	10	U	10	0.90	ug/L			06/14/22 18:31	1
Xylenes, Total	10	U	10	0.66	ug/L			06/14/22 18:31	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/14/22 18:31	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	106		77 - 120		06/14/22 18:31	1
Toluene-d8 (Surr)	94		80 - 120		06/14/22 18:31	1
4-Bromofluorobenzene (Surr)	108		73 - 120		06/14/22 18:31	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 16:12	1
Chromium	10.0	U	10.0		ug/L		06/10/22 08:52	06/10/22 16:12	1
Lead	3.0	U	3.0		ug/L		06/10/22 08:52	06/10/22 16:12	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/10/22 00:17	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/10/22 00:17	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/10/22 00:17	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-12

Lab Sample ID: 480-198760-4

Date Collected: 06/03/22 09:27

Matrix: Ground Water

Date Received: 06/07/22 11:20

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/12/22 06:11	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/12/22 06:11	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/12/22 06:11	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/12/22 06:11	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/12/22 06:11	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/12/22 06:11	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/12/22 06:11	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/12/22 06:11	1
2-Hexanone	10	U	10	1.2	ug/L			06/12/22 06:11	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/12/22 06:11	1
Acetone	10	U	10	3.0	ug/L			06/12/22 06:11	1
Benzene	10	U	10	0.41	ug/L			06/12/22 06:11	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/12/22 06:11	1
Bromoform	10	U	10	0.26	ug/L			06/12/22 06:11	1
Bromomethane	10	U	10	0.69	ug/L			06/12/22 06:11	1
Carbon disulfide	10	U	10	0.19	ug/L			06/12/22 06:11	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/12/22 06:11	1
Chlorobenzene	10	U	10	0.75	ug/L			06/12/22 06:11	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/12/22 06:11	1
Chloroethane	10	U	10	0.32	ug/L			06/12/22 06:11	1
Chloroform	10	U	10	0.34	ug/L			06/12/22 06:11	1
Chloromethane	10	U	10	0.35	ug/L			06/12/22 06:11	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/12/22 06:11	1
Ethylbenzene	10	U	10	0.74	ug/L			06/12/22 06:11	1
Methylene Chloride	10	U	10	0.44	ug/L			06/12/22 06:11	1
Styrene	10	U	10	0.73	ug/L			06/12/22 06:11	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/12/22 06:11	1
Toluene	10	U	10	0.51	ug/L			06/12/22 06:11	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/12/22 06:11	1
Trichloroethene	10		10	0.46	ug/L			06/12/22 06:11	1
Vinyl chloride	10	U	10	0.90	ug/L			06/12/22 06:11	1
Xylenes, Total	10	U	10	0.66	ug/L			06/12/22 06:11	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/12/22 06:11	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	104		77 - 120		06/12/22 06:11	1
Toluene-d8 (Surr)	96		80 - 120		06/12/22 06:11	1
4-Bromofluorobenzene (Surr)	104		73 - 120		06/12/22 06:11	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 16:16	1
Chromium	10.0	U	10.0		ug/L		06/10/22 08:52	06/10/22 16:16	1
Lead	3.0	U	3.0		ug/L		06/10/22 08:52	06/10/22 16:16	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/10/22 00:20	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/10/22 00:20	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/10/22 00:20	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-13

Date Collected: 06/03/22 08:26

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-5

Matrix: Ground Water

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/12/22 06:34	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/12/22 06:34	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/12/22 06:34	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/12/22 06:34	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/12/22 06:34	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/12/22 06:34	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/12/22 06:34	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/12/22 06:34	1
2-Hexanone	10	U	10	1.2	ug/L			06/12/22 06:34	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/12/22 06:34	1
Acetone	10	U	10	3.0	ug/L			06/12/22 06:34	1
Benzene	10	U	10	0.41	ug/L			06/12/22 06:34	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/12/22 06:34	1
Bromoform	10	U	10	0.26	ug/L			06/12/22 06:34	1
Bromomethane	10	U	10	0.69	ug/L			06/12/22 06:34	1
Carbon disulfide	10	U	10	0.19	ug/L			06/12/22 06:34	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/12/22 06:34	1
Chlorobenzene	10	U	10	0.75	ug/L			06/12/22 06:34	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/12/22 06:34	1
Chloroethane	10	U	10	0.32	ug/L			06/12/22 06:34	1
Chloroform	10	U	10	0.34	ug/L			06/12/22 06:34	1
Chloromethane	10	U	10	0.35	ug/L			06/12/22 06:34	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/12/22 06:34	1
Ethylbenzene	10	U	10	0.74	ug/L			06/12/22 06:34	1
Methylene Chloride	10	U	10	0.44	ug/L			06/12/22 06:34	1
Styrene	10	U	10	0.73	ug/L			06/12/22 06:34	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/12/22 06:34	1
Toluene	10	U	10	0.51	ug/L			06/12/22 06:34	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/12/22 06:34	1
Trichloroethene	1.0	J	10	0.46	ug/L			06/12/22 06:34	1
Vinyl chloride	10	U	10	0.90	ug/L			06/12/22 06:34	1
Xylenes, Total	10	U	10	0.66	ug/L			06/12/22 06:34	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/12/22 06:34	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	104		77 - 120		06/12/22 06:34	1
Toluene-d8 (Surr)	95		80 - 120		06/12/22 06:34	1
4-Bromofluorobenzene (Surr)	102		73 - 120		06/12/22 06:34	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 16:20	1
Chromium	10.0	U	10.0		ug/L		06/10/22 08:52	06/10/22 16:20	1
Lead	3.0	U	3.0		ug/L		06/10/22 08:52	06/10/22 16:20	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/10/22 00:24	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/10/22 00:24	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/10/22 00:24	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-14

Date Collected: 06/06/22 08:44

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-6

Matrix: Ground Water

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/14/22 18:53	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/14/22 18:53	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/14/22 18:53	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/14/22 18:53	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/14/22 18:53	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/14/22 18:53	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/14/22 18:53	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/14/22 18:53	1
2-Hexanone	10	U	10	1.2	ug/L			06/14/22 18:53	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/14/22 18:53	1
Acetone	10	U	10	3.0	ug/L			06/14/22 18:53	1
Benzene	10	U	10	0.41	ug/L			06/14/22 18:53	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/14/22 18:53	1
Bromoform	10	U	10	0.26	ug/L			06/14/22 18:53	1
Bromomethane	10	U	10	0.69	ug/L			06/14/22 18:53	1
Carbon disulfide	10	U	10	0.19	ug/L			06/14/22 18:53	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/14/22 18:53	1
Chlorobenzene	10	U	10	0.75	ug/L			06/14/22 18:53	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/14/22 18:53	1
Chloroethane	10	U	10	0.32	ug/L			06/14/22 18:53	1
Chloroform	10	U	10	0.34	ug/L			06/14/22 18:53	1
Chloromethane	10	U	10	0.35	ug/L			06/14/22 18:53	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/14/22 18:53	1
Ethylbenzene	10	U	10	0.74	ug/L			06/14/22 18:53	1
Methylene Chloride	10	U	10	0.44	ug/L			06/14/22 18:53	1
Styrene	10	U	10	0.73	ug/L			06/14/22 18:53	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/14/22 18:53	1
Toluene	10	U	10	0.51	ug/L			06/14/22 18:53	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/14/22 18:53	1
Trichloroethene	10	U	10	0.46	ug/L			06/14/22 18:53	1
Vinyl chloride	10	U	10	0.90	ug/L			06/14/22 18:53	1
Xylenes, Total	10	U	10	0.66	ug/L			06/14/22 18:53	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/14/22 18:53	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	108		77 - 120		06/14/22 18:53	1
Toluene-d8 (Surr)	95		80 - 120		06/14/22 18:53	1
4-Bromofluorobenzene (Surr)	107		73 - 120		06/14/22 18:53	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 16:35	1
Chromium	27.4		10.0		ug/L		06/10/22 08:52	06/10/22 16:35	1
Lead	23.1		3.0		ug/L		06/10/22 08:52	06/10/22 16:35	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/10/22 00:28	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/10/22 00:28	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/10/22 00:28	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-1DA

Lab Sample ID: 480-198760-7

Date Collected: 06/03/22 12:18

Matrix: Ground Water

Date Received: 06/07/22 11:20

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/12/22 06:56	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/12/22 06:56	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/12/22 06:56	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/12/22 06:56	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/12/22 06:56	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/12/22 06:56	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/12/22 06:56	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/12/22 06:56	1
2-Hexanone	10	U	10	1.2	ug/L			06/12/22 06:56	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/12/22 06:56	1
Acetone	10	U	10	3.0	ug/L			06/12/22 06:56	1
Benzene	10	U	10	0.41	ug/L			06/12/22 06:56	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/12/22 06:56	1
Bromoform	10	U	10	0.26	ug/L			06/12/22 06:56	1
Bromomethane	10	U	10	0.69	ug/L			06/12/22 06:56	1
Carbon disulfide	10	U	10	0.19	ug/L			06/12/22 06:56	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/12/22 06:56	1
Chlorobenzene	10	U	10	0.75	ug/L			06/12/22 06:56	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/12/22 06:56	1
Chloroethane	10	U	10	0.32	ug/L			06/12/22 06:56	1
Chloroform	10	U	10	0.34	ug/L			06/12/22 06:56	1
Chloromethane	10	U	10	0.35	ug/L			06/12/22 06:56	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/12/22 06:56	1
Ethylbenzene	10	U	10	0.74	ug/L			06/12/22 06:56	1
Methylene Chloride	10	U	10	0.44	ug/L			06/12/22 06:56	1
Styrene	10	U	10	0.73	ug/L			06/12/22 06:56	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/12/22 06:56	1
Toluene	10	U	10	0.51	ug/L			06/12/22 06:56	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/12/22 06:56	1
Trichloroethene	10	U	10	0.46	ug/L			06/12/22 06:56	1
Vinyl chloride	10	U	10	0.90	ug/L			06/12/22 06:56	1
Xylenes, Total	10	U	10	0.66	ug/L			06/12/22 06:56	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/12/22 06:56	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	104		77 - 120		06/12/22 06:56	1
Toluene-d8 (Surr)	96		80 - 120		06/12/22 06:56	1
4-Bromofluorobenzene (Surr)	104		73 - 120		06/12/22 06:56	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 16:39	1
Chromium	10.0	U	10.0		ug/L		06/10/22 08:52	06/10/22 16:39	1
Lead	3.0	U	3.0		ug/L		06/10/22 08:52	06/10/22 16:39	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/10/22 00:32	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/10/22 00:32	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/10/22 00:32	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-2A

Lab Sample ID: 480-198760-8

Date Collected: 06/06/22 12:49

Matrix: Ground Water

Date Received: 06/07/22 11:20

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/14/22 19:14	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/14/22 19:14	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/14/22 19:14	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/14/22 19:14	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/14/22 19:14	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/14/22 19:14	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/14/22 19:14	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/14/22 19:14	1
2-Hexanone	10	U	10	1.2	ug/L			06/14/22 19:14	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/14/22 19:14	1
Acetone	3.7	J	10	3.0	ug/L			06/14/22 19:14	1
Benzene	10	U	10	0.41	ug/L			06/14/22 19:14	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/14/22 19:14	1
Bromoform	10	U	10	0.26	ug/L			06/14/22 19:14	1
Bromomethane	10	U	10	0.69	ug/L			06/14/22 19:14	1
Carbon disulfide	10	U	10	0.19	ug/L			06/14/22 19:14	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/14/22 19:14	1
Chlorobenzene	10	U	10	0.75	ug/L			06/14/22 19:14	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/14/22 19:14	1
Chloroethane	10	U	10	0.32	ug/L			06/14/22 19:14	1
Chloroform	10	U	10	0.34	ug/L			06/14/22 19:14	1
Chloromethane	10	U	10	0.35	ug/L			06/14/22 19:14	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/14/22 19:14	1
Ethylbenzene	10	U	10	0.74	ug/L			06/14/22 19:14	1
Methylene Chloride	10	U	10	0.44	ug/L			06/14/22 19:14	1
Styrene	10	U	10	0.73	ug/L			06/14/22 19:14	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/14/22 19:14	1
Toluene	10	U	10	0.51	ug/L			06/14/22 19:14	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/14/22 19:14	1
Trichloroethene	1.9	J	10	0.46	ug/L			06/14/22 19:14	1
Vinyl chloride	10	U	10	0.90	ug/L			06/14/22 19:14	1
Xylenes, Total	10	U	10	0.66	ug/L			06/14/22 19:14	1
1,2-Dichloroethene, Total	2.9	J	10	0.81	ug/L			06/14/22 19:14	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	111		77 - 120		06/14/22 19:14	1
Toluene-d8 (Surr)	98		80 - 120		06/14/22 19:14	1
4-Bromofluorobenzene (Surr)	106		73 - 120		06/14/22 19:14	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 16:43	1
Chromium	10.0	U	10.0		ug/L		06/10/22 08:52	06/10/22 16:43	1
Lead	3.0	U	3.0		ug/L		06/10/22 08:52	06/10/22 16:43	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/10/22 00:47	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/10/22 00:47	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/10/22 00:47	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-3

Lab Sample ID: 480-198760-9

Date Collected: 06/06/22 10:36

Matrix: Ground Water

Date Received: 06/07/22 11:20

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/14/22 19:36	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/14/22 19:36	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/14/22 19:36	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/14/22 19:36	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/14/22 19:36	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/14/22 19:36	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/14/22 19:36	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/14/22 19:36	1
2-Hexanone	10	U	10	1.2	ug/L			06/14/22 19:36	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/14/22 19:36	1
Acetone	10	U	10	3.0	ug/L			06/14/22 19:36	1
Benzene	10	U	10	0.41	ug/L			06/14/22 19:36	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/14/22 19:36	1
Bromoform	10	U	10	0.26	ug/L			06/14/22 19:36	1
Bromomethane	10	U	10	0.69	ug/L			06/14/22 19:36	1
Carbon disulfide	10	U	10	0.19	ug/L			06/14/22 19:36	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/14/22 19:36	1
Chlorobenzene	10	U	10	0.75	ug/L			06/14/22 19:36	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/14/22 19:36	1
Chloroethane	10	U	10	0.32	ug/L			06/14/22 19:36	1
Chloroform	10	U	10	0.34	ug/L			06/14/22 19:36	1
Chloromethane	10	U	10	0.35	ug/L			06/14/22 19:36	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/14/22 19:36	1
Ethylbenzene	10	U	10	0.74	ug/L			06/14/22 19:36	1
Methylene Chloride	10	U	10	0.44	ug/L			06/14/22 19:36	1
Styrene	10	U	10	0.73	ug/L			06/14/22 19:36	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/14/22 19:36	1
Toluene	10	U	10	0.51	ug/L			06/14/22 19:36	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/14/22 19:36	1
Trichloroethene	0.76	J	10	0.46	ug/L			06/14/22 19:36	1
Vinyl chloride	10	U	10	0.90	ug/L			06/14/22 19:36	1
Xylenes, Total	10	U	10	0.66	ug/L			06/14/22 19:36	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/14/22 19:36	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	106		77 - 120		06/14/22 19:36	1
Toluene-d8 (Surr)	97		80 - 120		06/14/22 19:36	1
4-Bromofluorobenzene (Surr)	108		73 - 120		06/14/22 19:36	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 16:47	1
Chromium	10.0	U	10.0		ug/L		06/10/22 08:52	06/10/22 16:47	1
Lead	3.0	U	3.0		ug/L		06/10/22 08:52	06/10/22 16:47	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/10/22 00:51	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/10/22 00:51	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/10/22 00:51	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-5

Lab Sample ID: 480-198760-10

Date Collected: 06/07/22 09:55

Matrix: Ground Water

Date Received: 06/07/22 11:20

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/14/22 19:58	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/14/22 19:58	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/14/22 19:58	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/14/22 19:58	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/14/22 19:58	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/14/22 19:58	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/14/22 19:58	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/14/22 19:58	1
2-Hexanone	10	U	10	1.2	ug/L			06/14/22 19:58	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/14/22 19:58	1
Acetone	10	U	10	3.0	ug/L			06/14/22 19:58	1
Benzene	10	U	10	0.41	ug/L			06/14/22 19:58	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/14/22 19:58	1
Bromoform	10	U	10	0.26	ug/L			06/14/22 19:58	1
Bromomethane	10	U	10	0.69	ug/L			06/14/22 19:58	1
Carbon disulfide	10	U	10	0.19	ug/L			06/14/22 19:58	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/14/22 19:58	1
Chlorobenzene	10	U	10	0.75	ug/L			06/14/22 19:58	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/14/22 19:58	1
Chloroethane	10	U	10	0.32	ug/L			06/14/22 19:58	1
Chloroform	10	U	10	0.34	ug/L			06/14/22 19:58	1
Chloromethane	10	U	10	0.35	ug/L			06/14/22 19:58	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/14/22 19:58	1
Ethylbenzene	10	U	10	0.74	ug/L			06/14/22 19:58	1
Methylene Chloride	10	U	10	0.44	ug/L			06/14/22 19:58	1
Styrene	10	U	10	0.73	ug/L			06/14/22 19:58	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/14/22 19:58	1
Toluene	10	U	10	0.51	ug/L			06/14/22 19:58	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/14/22 19:58	1
Trichloroethene	10	U	10	0.46	ug/L			06/14/22 19:58	1
Vinyl chloride	10	U	10	0.90	ug/L			06/14/22 19:58	1
Xylenes, Total	10	U	10	0.66	ug/L			06/14/22 19:58	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/14/22 19:58	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	109		77 - 120		06/14/22 19:58	1
Toluene-d8 (Surr)	99		80 - 120		06/14/22 19:58	1
4-Bromofluorobenzene (Surr)	106		73 - 120		06/14/22 19:58	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 16:50	1
Chromium	17.1		10.0		ug/L		06/10/22 08:52	06/10/22 16:50	1
Lead	13.4		3.0		ug/L		06/10/22 08:52	06/10/22 16:50	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/10/22 00:55	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/10/22 00:55	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/10/22 00:55	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-6A

Lab Sample ID: 480-198760-11

Date Collected: 06/06/22 13:34

Matrix: Ground Water

Date Received: 06/07/22 11:20

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/14/22 20:20	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/14/22 20:20	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/14/22 20:20	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/14/22 20:20	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/14/22 20:20	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/14/22 20:20	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/14/22 20:20	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/14/22 20:20	1
2-Hexanone	10	U	10	1.2	ug/L			06/14/22 20:20	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/14/22 20:20	1
Acetone	10	U	10	3.0	ug/L			06/14/22 20:20	1
Benzene	10	U	10	0.41	ug/L			06/14/22 20:20	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/14/22 20:20	1
Bromoform	10	U	10	0.26	ug/L			06/14/22 20:20	1
Bromomethane	10	U	10	0.69	ug/L			06/14/22 20:20	1
Carbon disulfide	10	U	10	0.19	ug/L			06/14/22 20:20	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/14/22 20:20	1
Chlorobenzene	10	U	10	0.75	ug/L			06/14/22 20:20	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/14/22 20:20	1
Chloroethane	10	U	10	0.32	ug/L			06/14/22 20:20	1
Chloroform	10	U	10	0.34	ug/L			06/14/22 20:20	1
Chloromethane	10	U	10	0.35	ug/L			06/14/22 20:20	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/14/22 20:20	1
Ethylbenzene	10	U	10	0.74	ug/L			06/14/22 20:20	1
Methylene Chloride	10	U	10	0.44	ug/L			06/14/22 20:20	1
Styrene	10	U	10	0.73	ug/L			06/14/22 20:20	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/14/22 20:20	1
Toluene	10	U	10	0.51	ug/L			06/14/22 20:20	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/14/22 20:20	1
Trichloroethene	18		10	0.46	ug/L			06/14/22 20:20	1
Vinyl chloride	10	U	10	0.90	ug/L			06/14/22 20:20	1
Xylenes, Total	10	U	10	0.66	ug/L			06/14/22 20:20	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/14/22 20:20	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	105		77 - 120		06/14/22 20:20	1
Toluene-d8 (Surr)	96		80 - 120		06/14/22 20:20	1
4-Bromofluorobenzene (Surr)	108		73 - 120		06/14/22 20:20	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 16:54	1
Chromium	10.0	U	10.0		ug/L		06/10/22 08:52	06/10/22 16:54	1
Lead	3.0	U	3.0		ug/L		06/10/22 08:52	06/10/22 16:54	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/10/22 00:59	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/10/22 00:59	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/10/22 00:59	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-6DA

Lab Sample ID: 480-198760-12

Date Collected: 06/06/22 15:00

Matrix: Ground Water

Date Received: 06/07/22 11:20

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/14/22 20:42	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/14/22 20:42	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/14/22 20:42	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/14/22 20:42	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/14/22 20:42	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/14/22 20:42	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/14/22 20:42	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/14/22 20:42	1
2-Hexanone	10	U	10	1.2	ug/L			06/14/22 20:42	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/14/22 20:42	1
Acetone	10	U	10	3.0	ug/L			06/14/22 20:42	1
Benzene	10	U	10	0.41	ug/L			06/14/22 20:42	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/14/22 20:42	1
Bromoform	10	U	10	0.26	ug/L			06/14/22 20:42	1
Bromomethane	10	U	10	0.69	ug/L			06/14/22 20:42	1
Carbon disulfide	10	U	10	0.19	ug/L			06/14/22 20:42	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/14/22 20:42	1
Chlorobenzene	10	U	10	0.75	ug/L			06/14/22 20:42	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/14/22 20:42	1
Chloroethane	10	U	10	0.32	ug/L			06/14/22 20:42	1
Chloroform	10	U	10	0.34	ug/L			06/14/22 20:42	1
Chloromethane	10	U	10	0.35	ug/L			06/14/22 20:42	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/14/22 20:42	1
Ethylbenzene	10	U	10	0.74	ug/L			06/14/22 20:42	1
Methylene Chloride	10	U	10	0.44	ug/L			06/14/22 20:42	1
Styrene	10	U	10	0.73	ug/L			06/14/22 20:42	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/14/22 20:42	1
Toluene	10	U	10	0.51	ug/L			06/14/22 20:42	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/14/22 20:42	1
Trichloroethene	10	U	10	0.46	ug/L			06/14/22 20:42	1
Vinyl chloride	10	U	10	0.90	ug/L			06/14/22 20:42	1
Xylenes, Total	10	U	10	0.66	ug/L			06/14/22 20:42	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/14/22 20:42	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	109		77 - 120		06/14/22 20:42	1
Toluene-d8 (Surr)	96		80 - 120		06/14/22 20:42	1
4-Bromofluorobenzene (Surr)	107		73 - 120		06/14/22 20:42	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 16:58	1
Chromium	10.0	U	10.0		ug/L		06/10/22 08:52	06/10/22 16:58	1
Lead	15.5		3.0		ug/L		06/10/22 08:52	06/10/22 16:58	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/10/22 01:03	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/10/22 01:03	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/10/22 01:03	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-7

Lab Sample ID: 480-198760-13

Date Collected: 06/06/22 11:23

Matrix: Ground Water

Date Received: 06/07/22 11:20

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/14/22 21:04	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/14/22 21:04	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/14/22 21:04	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/14/22 21:04	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/14/22 21:04	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/14/22 21:04	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/14/22 21:04	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/14/22 21:04	1
2-Hexanone	10	U	10	1.2	ug/L			06/14/22 21:04	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/14/22 21:04	1
Acetone	10	U	10	3.0	ug/L			06/14/22 21:04	1
Benzene	10	U	10	0.41	ug/L			06/14/22 21:04	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/14/22 21:04	1
Bromoform	10	U	10	0.26	ug/L			06/14/22 21:04	1
Bromomethane	10	U	10	0.69	ug/L			06/14/22 21:04	1
Carbon disulfide	10	U	10	0.19	ug/L			06/14/22 21:04	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/14/22 21:04	1
Chlorobenzene	10	U	10	0.75	ug/L			06/14/22 21:04	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/14/22 21:04	1
Chloroethane	10	U	10	0.32	ug/L			06/14/22 21:04	1
Chloroform	10	U	10	0.34	ug/L			06/14/22 21:04	1
Chloromethane	10	U	10	0.35	ug/L			06/14/22 21:04	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/14/22 21:04	1
Ethylbenzene	10	U	10	0.74	ug/L			06/14/22 21:04	1
Methylene Chloride	10	U	10	0.44	ug/L			06/14/22 21:04	1
Styrene	10	U	10	0.73	ug/L			06/14/22 21:04	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/14/22 21:04	1
Toluene	10	U	10	0.51	ug/L			06/14/22 21:04	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/14/22 21:04	1
Trichloroethene	10	U	10	0.46	ug/L			06/14/22 21:04	1
Vinyl chloride	10	U	10	0.90	ug/L			06/14/22 21:04	1
Xylenes, Total	10	U	10	0.66	ug/L			06/14/22 21:04	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/14/22 21:04	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	108		77 - 120		06/14/22 21:04	1
Toluene-d8 (Surr)	96		80 - 120		06/14/22 21:04	1
4-Bromofluorobenzene (Surr)	110		73 - 120		06/14/22 21:04	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 17:02	1
Chromium	10.0	U	10.0		ug/L		06/10/22 08:52	06/10/22 17:02	1
Lead	3.0	U	3.0		ug/L		06/10/22 08:52	06/10/22 17:02	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/10/22 01:07	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/10/22 01:07	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/10/22 01:07	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-9

Lab Sample ID: 480-198760-14

Date Collected: 06/03/22 13:34

Matrix: Ground Water

Date Received: 06/07/22 11:20

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/12/22 07:17	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/12/22 07:17	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/12/22 07:17	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/12/22 07:17	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/12/22 07:17	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/12/22 07:17	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/12/22 07:17	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/12/22 07:17	1
2-Hexanone	10	U	10	1.2	ug/L			06/12/22 07:17	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/12/22 07:17	1
Acetone	10	U	10	3.0	ug/L			06/12/22 07:17	1
Benzene	10	U	10	0.41	ug/L			06/12/22 07:17	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/12/22 07:17	1
Bromoform	10	U	10	0.26	ug/L			06/12/22 07:17	1
Bromomethane	10	U	10	0.69	ug/L			06/12/22 07:17	1
Carbon disulfide	10	U	10	0.19	ug/L			06/12/22 07:17	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/12/22 07:17	1
Chlorobenzene	10	U	10	0.75	ug/L			06/12/22 07:17	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/12/22 07:17	1
Chloroethane	10	U	10	0.32	ug/L			06/12/22 07:17	1
Chloroform	10	U	10	0.34	ug/L			06/12/22 07:17	1
Chloromethane	10	U	10	0.35	ug/L			06/12/22 07:17	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/12/22 07:17	1
Ethylbenzene	10	U	10	0.74	ug/L			06/12/22 07:17	1
Methylene Chloride	10	U	10	0.44	ug/L			06/12/22 07:17	1
Styrene	10	U	10	0.73	ug/L			06/12/22 07:17	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/12/22 07:17	1
Toluene	10	U	10	0.51	ug/L			06/12/22 07:17	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/12/22 07:17	1
Trichloroethene	6.5	J	10	0.46	ug/L			06/12/22 07:17	1
Vinyl chloride	10	U	10	0.90	ug/L			06/12/22 07:17	1
Xylenes, Total	10	U	10	0.66	ug/L			06/12/22 07:17	1
1,2-Dichloroethene, Total	0.83	J	10	0.81	ug/L			06/12/22 07:17	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	105		77 - 120		06/12/22 07:17	1
Toluene-d8 (Surr)	93		80 - 120		06/12/22 07:17	1
4-Bromofluorobenzene (Surr)	104		73 - 120		06/12/22 07:17	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 17:06	1
Chromium	10.0	U	10.0		ug/L		06/10/22 08:52	06/10/22 17:06	1
Lead	14.2		3.0		ug/L		06/10/22 08:52	06/10/22 17:06	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/10/22 01:10	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/10/22 01:10	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/10/22 01:10	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-9D

Lab Sample ID: 480-198760-15

Date Collected: 06/03/22 14:58

Matrix: Ground Water

Date Received: 06/07/22 11:20

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/12/22 07:40	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/12/22 07:40	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/12/22 07:40	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/12/22 07:40	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/12/22 07:40	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/12/22 07:40	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/12/22 07:40	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/12/22 07:40	1
2-Hexanone	10	U	10	1.2	ug/L			06/12/22 07:40	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/12/22 07:40	1
Acetone	10	U	10	3.0	ug/L			06/12/22 07:40	1
Benzene	10	U	10	0.41	ug/L			06/12/22 07:40	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/12/22 07:40	1
Bromoform	10	U	10	0.26	ug/L			06/12/22 07:40	1
Bromomethane	10	U	10	0.69	ug/L			06/12/22 07:40	1
Carbon disulfide	10	U	10	0.19	ug/L			06/12/22 07:40	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/12/22 07:40	1
Chlorobenzene	10	U	10	0.75	ug/L			06/12/22 07:40	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/12/22 07:40	1
Chloroethane	10	U	10	0.32	ug/L			06/12/22 07:40	1
Chloroform	10	U	10	0.34	ug/L			06/12/22 07:40	1
Chloromethane	10	U	10	0.35	ug/L			06/12/22 07:40	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/12/22 07:40	1
Ethylbenzene	10	U	10	0.74	ug/L			06/12/22 07:40	1
Methylene Chloride	10	U	10	0.44	ug/L			06/12/22 07:40	1
Styrene	10	U	10	0.73	ug/L			06/12/22 07:40	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/12/22 07:40	1
Toluene	10	U	10	0.51	ug/L			06/12/22 07:40	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/12/22 07:40	1
Trichloroethene	10	U	10	0.46	ug/L			06/12/22 07:40	1
Vinyl chloride	10	U	10	0.90	ug/L			06/12/22 07:40	1
Xylenes, Total	10	U	10	0.66	ug/L			06/12/22 07:40	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/12/22 07:40	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	104		77 - 120		06/12/22 07:40	1
Toluene-d8 (Surr)	95		80 - 120		06/12/22 07:40	1
4-Bromofluorobenzene (Surr)	105		73 - 120		06/12/22 07:40	1

Method: 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/09/22 13:09	06/10/22 02:27	1
Chromium	10.0	U	10.0		ug/L		06/09/22 13:09	06/10/22 02:27	1
Lead	11.4		3.0		ug/L		06/09/22 13:09	06/10/22 02:27	1

Method: 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/10/22 01:14	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/10/22 01:14	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/10/22 01:14	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: TRIP BLANK

Lab Sample ID: 480-198760-16

Date Collected: 06/06/22 14:30

Matrix: Ground Water

Date Received: 06/07/22 11:20

Method: 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/14/22 21:26	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/14/22 21:26	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/14/22 21:26	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/14/22 21:26	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/14/22 21:26	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/14/22 21:26	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/14/22 21:26	1
2-Butanone (MEK)	10	*+ U	10	1.3	ug/L			06/14/22 21:26	1
2-Hexanone	10	U	10	1.2	ug/L			06/14/22 21:26	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/14/22 21:26	1
Acetone	10	U	10	3.0	ug/L			06/14/22 21:26	1
Benzene	10	U	10	0.41	ug/L			06/14/22 21:26	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/14/22 21:26	1
Bromoform	10	U	10	0.26	ug/L			06/14/22 21:26	1
Bromomethane	10	U	10	0.69	ug/L			06/14/22 21:26	1
Carbon disulfide	10	U	10	0.19	ug/L			06/14/22 21:26	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/14/22 21:26	1
Chlorobenzene	10	U	10	0.75	ug/L			06/14/22 21:26	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/14/22 21:26	1
Chloroethane	10	U	10	0.32	ug/L			06/14/22 21:26	1
Chloroform	10	U	10	0.34	ug/L			06/14/22 21:26	1
Chloromethane	10	U	10	0.35	ug/L			06/14/22 21:26	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/14/22 21:26	1
Ethylbenzene	10	U	10	0.74	ug/L			06/14/22 21:26	1
Methylene Chloride	10	U	10	0.44	ug/L			06/14/22 21:26	1
Styrene	10	U	10	0.73	ug/L			06/14/22 21:26	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/14/22 21:26	1
Toluene	10	U	10	0.51	ug/L			06/14/22 21:26	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/14/22 21:26	1
Trichloroethene	10	U	10	0.46	ug/L			06/14/22 21:26	1
Vinyl chloride	10	U	10	0.90	ug/L			06/14/22 21:26	1
Xylenes, Total	10	U	10	0.66	ug/L			06/14/22 21:26	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/14/22 21:26	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	110		77 - 120		06/14/22 21:26	1
Toluene-d8 (Surr)	99		80 - 120		06/14/22 21:26	1
4-Bromofluorobenzene (Surr)	110		73 - 120		06/14/22 21:26	1

Eurofins Buffalo

Surrogate Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Method: 8260C - Volatile Organic Compounds by GC/MS

Matrix: Ground Water

Prep Type: Total/NA

Lab Sample ID	Client Sample ID	Percent Surrogate Recovery (Acceptance Limits)		
		DCA (77-120)	TOL (80-120)	BFB (73-120)
480-198760-1	Dup	102	94	104
480-198760-2	MW-1	103	95	103
480-198760-2 MS	MW-1	98	100	98
480-198760-2 MSD	MW-1	100	99	99
480-198760-3	MW-11	106	94	108
480-198760-4	MW-12	104	96	104
480-198760-5	MW-13	104	95	102
480-198760-6	MW-14	108	95	107
480-198760-7	MW-1DA	104	96	104
480-198760-8	MW-2A	111	98	106
480-198760-9	MW-3	106	97	108
480-198760-10	MW-5	109	99	106
480-198760-11	MW-6A	105	96	108
480-198760-12	MW-6DA	109	96	107
480-198760-13	MW-7	108	96	110
480-198760-14	MW-9	105	93	104
480-198760-15	MW-9D	104	95	105
480-198760-16	TRIP BLANK	110	99	110

Surrogate Legend

DCA = 1,2-Dichloroethane-d4 (Surr)

TOL = Toluene-d8 (Surr)

BFB = 4-Bromofluorobenzene (Surr)

Method: 8260C - Volatile Organic Compounds by GC/MS

Matrix: Water

Prep Type: Total/NA

Lab Sample ID	Client Sample ID	Percent Surrogate Recovery (Acceptance Limits)		
		DCA (77-120)	TOL (80-120)	BFB (73-120)
LCS 480-629687/5	Lab Control Sample	96	99	96
LCS 480-629695/6	Lab Control Sample	107	98	96
LCS 480-629936/5	Lab Control Sample	108	98	101
LCSD 480-629695/7	Lab Control Sample Dup	102	98	97
LCSD 480-629936/6	Lab Control Sample Dup	105	99	100
MB 480-629687/7	Method Blank	101	98	98
MB 480-629695/9	Method Blank	102	98	102
MB 480-629936/8	Method Blank	104	99	104

Surrogate Legend

DCA = 1,2-Dichloroethane-d4 (Surr)

TOL = Toluene-d8 (Surr)

BFB = 4-Bromofluorobenzene (Surr)

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Method: 8260C - Volatile Organic Compounds by GC/MS

Lab Sample ID: MB 480-629687/7

Matrix: Water

Analysis Batch: 629687

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/11/22 13:10	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/11/22 13:10	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/11/22 13:10	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/11/22 13:10	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/11/22 13:10	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/11/22 13:10	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/11/22 13:10	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			06/11/22 13:10	1
2-Hexanone	10	U	10	1.2	ug/L			06/11/22 13:10	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/11/22 13:10	1
Acetone	10	U	10	3.0	ug/L			06/11/22 13:10	1
Benzene	10	U	10	0.41	ug/L			06/11/22 13:10	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/11/22 13:10	1
Bromoform	10	U	10	0.26	ug/L			06/11/22 13:10	1
Bromomethane	10	U	10	0.69	ug/L			06/11/22 13:10	1
Carbon disulfide	10	U	10	0.19	ug/L			06/11/22 13:10	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/11/22 13:10	1
Chlorobenzene	10	U	10	0.75	ug/L			06/11/22 13:10	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/11/22 13:10	1
Chloroethane	10	U	10	0.32	ug/L			06/11/22 13:10	1
Chloroform	10	U	10	0.34	ug/L			06/11/22 13:10	1
Chloromethane	10	U	10	0.35	ug/L			06/11/22 13:10	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/11/22 13:10	1
Ethylbenzene	10	U	10	0.74	ug/L			06/11/22 13:10	1
Methylene Chloride	10	U	10	0.44	ug/L			06/11/22 13:10	1
Styrene	10	U	10	0.73	ug/L			06/11/22 13:10	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/11/22 13:10	1
Toluene	10	U	10	0.51	ug/L			06/11/22 13:10	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/11/22 13:10	1
Trichloroethene	10	U	10	0.46	ug/L			06/11/22 13:10	1
Vinyl chloride	10	U	10	0.90	ug/L			06/11/22 13:10	1
Xylenes, Total	10	U	10	0.66	ug/L			06/11/22 13:10	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/11/22 13:10	1

Surrogate	MB %Recovery	MB Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	101		77 - 120		06/11/22 13:10	1
Toluene-d8 (Surr)	98		80 - 120		06/11/22 13:10	1
4-Bromofluorobenzene (Surr)	98		73 - 120		06/11/22 13:10	1

Lab Sample ID: LCS 480-629687/5

Matrix: Water

Analysis Batch: 629687

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
1,1-Dichloroethane	25.0	24.2		ug/L		97	77 - 120
Benzene	25.0	25.1		ug/L		100	71 - 124
Chlorobenzene	25.0	24.7		ug/L		99	80 - 120
Toluene	25.0	25.6		ug/L		103	80 - 122

Eurofins Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Method: 8260C - Volatile Organic Compounds by GC/MS (Continued)

Lab Sample ID: LCS 480-629687/5

Matrix: Water

Analysis Batch: 629687

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Trichloroethene	25.0	25.9		ug/L		104	74 - 123
Surrogate	LCS %Recovery	LCS Qualifier	Limits				
1,2-Dichloroethane-d4 (Surr)	96		77 - 120				
Toluene-d8 (Surr)	99		80 - 120				
4-Bromofluorobenzene (Surr)	96		73 - 120				

Lab Sample ID: 480-198760-2 MS

Matrix: Ground Water

Analysis Batch: 629687

Client Sample ID: MW-1

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
1,1-Dichloroethane	10		25.0	28.0		ug/L		112	77 - 120
Benzene	10		25.0	28.4		ug/L		114	71 - 124
Chlorobenzene	10		25.0	27.8		ug/L		111	80 - 120
Toluene	10		25.0	29.1		ug/L		116	80 - 122
Trichloroethene	11	F1	25.0	40.3		ug/L		117	74 - 123
Surrogate	MS %Recovery	MS Qualifier	Limits						
1,2-Dichloroethane-d4 (Surr)	98		77 - 120						
Toluene-d8 (Surr)	100		80 - 120						
4-Bromofluorobenzene (Surr)	98		73 - 120						

Lab Sample ID: 480-198760-2 MSD

Matrix: Ground Water

Analysis Batch: 629687

Client Sample ID: MW-1

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
1,1-Dichloroethane	10		25.0	29.4		ug/L		117	77 - 120	5	20
Benzene	10		25.0	30.4		ug/L		122	71 - 124	7	13
Chlorobenzene	10		25.0	29.2		ug/L		117	80 - 120	5	25
Toluene	10		25.0	30.3		ug/L		121	80 - 122	4	15
Trichloroethene	11	F1	25.0	42.7	F1	ug/L		126	74 - 123	6	16
Surrogate	MSD %Recovery	MSD Qualifier	Limits								
1,2-Dichloroethane-d4 (Surr)	100		77 - 120								
Toluene-d8 (Surr)	99		80 - 120								
4-Bromofluorobenzene (Surr)	99		73 - 120								

Lab Sample ID: MB 480-629695/9

Matrix: Water

Analysis Batch: 629695

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/12/22 01:04	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/12/22 01:04	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/12/22 01:04	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/12/22 01:04	1

Eurofins Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Method: 8260C - Volatile Organic Compounds by GC/MS (Continued)

Lab Sample ID: MB 480-629695/9

Matrix: Water

Analysis Batch: 629695

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/12/22 01:04	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/12/22 01:04	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/12/22 01:04	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			06/12/22 01:04	1
2-Hexanone	10	U	10	1.2	ug/L			06/12/22 01:04	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/12/22 01:04	1
Acetone	10	U	10	3.0	ug/L			06/12/22 01:04	1
Benzene	10	U	10	0.41	ug/L			06/12/22 01:04	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/12/22 01:04	1
Bromoform	10	U	10	0.26	ug/L			06/12/22 01:04	1
Bromomethane	10	U	10	0.69	ug/L			06/12/22 01:04	1
Carbon disulfide	10	U	10	0.19	ug/L			06/12/22 01:04	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/12/22 01:04	1
Chlorobenzene	10	U	10	0.75	ug/L			06/12/22 01:04	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/12/22 01:04	1
Chloroethane	10	U	10	0.32	ug/L			06/12/22 01:04	1
Chloroform	10	U	10	0.34	ug/L			06/12/22 01:04	1
Chloromethane	10	U	10	0.35	ug/L			06/12/22 01:04	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/12/22 01:04	1
Ethylbenzene	10	U	10	0.74	ug/L			06/12/22 01:04	1
Methylene Chloride	10	U	10	0.44	ug/L			06/12/22 01:04	1
Styrene	10	U	10	0.73	ug/L			06/12/22 01:04	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/12/22 01:04	1
Toluene	10	U	10	0.51	ug/L			06/12/22 01:04	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/12/22 01:04	1
Trichloroethene	10	U	10	0.46	ug/L			06/12/22 01:04	1
Vinyl chloride	10	U	10	0.90	ug/L			06/12/22 01:04	1
Xylenes, Total	10	U	10	0.66	ug/L			06/12/22 01:04	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/12/22 01:04	1

Surrogate	MB %Recovery	MB Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	102		77 - 120		06/12/22 01:04	1
Toluene-d8 (Surr)	98		80 - 120		06/12/22 01:04	1
4-Bromofluorobenzene (Surr)	102		73 - 120		06/12/22 01:04	1

Lab Sample ID: LCS 480-629695/6

Matrix: Water

Analysis Batch: 629695

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
1,1-Dichloroethane	25.0	27.3		ug/L		109	77 - 120
Benzene	25.0	26.7		ug/L		107	71 - 124
Chlorobenzene	25.0	25.6		ug/L		103	80 - 120
Toluene	25.0	26.5		ug/L		106	80 - 122
Trichloroethene	25.0	27.8		ug/L		111	74 - 123

Surrogate	LCS %Recovery	LCS Qualifier	Limits
1,2-Dichloroethane-d4 (Surr)	107		77 - 120

Eurofins Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Method: 8260C - Volatile Organic Compounds by GC/MS (Continued)

Lab Sample ID: LCS 480-629695/6

Matrix: Water

Analysis Batch: 629695

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

	LCS	LCS	
Surrogate	%Recovery	Qualifier	Limits
Toluene-d8 (Surr)	98		80 - 120
4-Bromofluorobenzene (Surr)	96		73 - 120

Lab Sample ID: LCSD 480-629695/7

Matrix: Water

Analysis Batch: 629695

Client Sample ID: Lab Control Sample Dup

Prep Type: Total/NA

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
1,1-Dichloroethane	25.0	25.5		ug/L		102	77 - 120	7	20
Benzene	25.0	25.3		ug/L		101	71 - 124	5	13
Chlorobenzene	25.0	25.0		ug/L		100	80 - 120	3	25
Toluene	25.0	25.6		ug/L		102	80 - 122	3	15
Trichloroethene	25.0	26.5		ug/L		106	74 - 123	5	16

	LCSD	LCSD	
Surrogate	%Recovery	Qualifier	Limits
1,2-Dichloroethane-d4 (Surr)	102		77 - 120
Toluene-d8 (Surr)	98		80 - 120
4-Bromofluorobenzene (Surr)	97		73 - 120

Lab Sample ID: MB 480-629936/8

Matrix: Water

Analysis Batch: 629936

Client Sample ID: Method Blank

Prep Type: Total/NA

	MB	MB							
Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/14/22 12:33	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/14/22 12:33	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/14/22 12:33	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/14/22 12:33	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/14/22 12:33	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/14/22 12:33	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/14/22 12:33	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			06/14/22 12:33	1
2-Hexanone	10	U	10	1.2	ug/L			06/14/22 12:33	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/14/22 12:33	1
Acetone	10	U	10	3.0	ug/L			06/14/22 12:33	1
Benzene	10	U	10	0.41	ug/L			06/14/22 12:33	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/14/22 12:33	1
Bromoform	10	U	10	0.26	ug/L			06/14/22 12:33	1
Bromomethane	10	U	10	0.69	ug/L			06/14/22 12:33	1
Carbon disulfide	10	U	10	0.19	ug/L			06/14/22 12:33	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/14/22 12:33	1
Chlorobenzene	10	U	10	0.75	ug/L			06/14/22 12:33	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/14/22 12:33	1
Chloroethane	10	U	10	0.32	ug/L			06/14/22 12:33	1
Chloroform	10	U	10	0.34	ug/L			06/14/22 12:33	1
Chloromethane	10	U	10	0.35	ug/L			06/14/22 12:33	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/14/22 12:33	1
Ethylbenzene	10	U	10	0.74	ug/L			06/14/22 12:33	1

Eurofins Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Method: 8260C - Volatile Organic Compounds by GC/MS (Continued)

Lab Sample ID: MB 480-629936/8

Matrix: Water

Analysis Batch: 629936

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Methylene Chloride	10	U	10	0.44	ug/L			06/14/22 12:33	1
Styrene	10	U	10	0.73	ug/L			06/14/22 12:33	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/14/22 12:33	1
Toluene	10	U	10	0.51	ug/L			06/14/22 12:33	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/14/22 12:33	1
Trichloroethene	10	U	10	0.46	ug/L			06/14/22 12:33	1
Vinyl chloride	10	U	10	0.90	ug/L			06/14/22 12:33	1
Xylenes, Total	10	U	10	0.66	ug/L			06/14/22 12:33	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/14/22 12:33	1

Surrogate	MB %Recovery	MB Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	104		77 - 120		06/14/22 12:33	1
Toluene-d8 (Surr)	99		80 - 120		06/14/22 12:33	1
4-Bromofluorobenzene (Surr)	104		73 - 120		06/14/22 12:33	1

Lab Sample ID: LCS 480-629936/5

Matrix: Water

Analysis Batch: 629936

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
1,1-Dichloroethane	25.0	26.2		ug/L		105	77 - 120
Benzene	25.0	25.7		ug/L		103	71 - 124
Chlorobenzene	25.0	25.2		ug/L		101	80 - 120
Toluene	25.0	25.7		ug/L		103	80 - 122
Trichloroethene	25.0	28.0		ug/L		112	74 - 123

Surrogate	LCS %Recovery	LCS Qualifier	Limits
1,2-Dichloroethane-d4 (Surr)	108		77 - 120
Toluene-d8 (Surr)	98		80 - 120
4-Bromofluorobenzene (Surr)	101		73 - 120

Lab Sample ID: LCSD 480-629936/6

Matrix: Water

Analysis Batch: 629936

Client Sample ID: Lab Control Sample Dup

Prep Type: Total/NA

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
1,1-Dichloroethane	25.0	26.1		ug/L		104	77 - 120	0	20
Benzene	25.0	25.0		ug/L		100	71 - 124	3	13
Chlorobenzene	25.0	24.9		ug/L		100	80 - 120	1	25
Toluene	25.0	25.5		ug/L		102	80 - 122	1	15
Trichloroethene	25.0	26.9		ug/L		108	74 - 123	4	16

Surrogate	LCSD %Recovery	LCSD Qualifier	Limits
1,2-Dichloroethane-d4 (Surr)	105		77 - 120
Toluene-d8 (Surr)	99		80 - 120
4-Bromofluorobenzene (Surr)	100		73 - 120

Eurofins Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Method: 6010C - Metals (ICP)

Lab Sample ID: MB 480-629261/1-A

Matrix: Water

Analysis Batch: 629775

Client Sample ID: Method Blank

Prep Type: Total/NA

Prep Batch: 629261

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/10/22 08:52	06/10/22 15:30	1
Chromium	10.0	U	10.0		ug/L		06/10/22 08:52	06/10/22 15:30	1
Lead	3.0	U	3.0		ug/L		06/10/22 08:52	06/10/22 15:30	1

Lab Sample ID: LCS 480-629261/2-A

Matrix: Water

Analysis Batch: 629775

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Prep Batch: 629261

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Cadmium	200	191.1		ug/L		96	80 - 120
Chromium	200	186.0		ug/L		93	80 - 120
Lead	200	191.3		ug/L		96	80 - 120

Lab Sample ID: 480-198760-2 MS

Matrix: Ground Water

Analysis Batch: 629775

Client Sample ID: MW-1

Prep Type: Total/NA

Prep Batch: 629261

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Cadmium	5.0		200	195.1		ug/L		98	75 - 125
Chromium	10.0		200	185.3		ug/L		93	75 - 125
Lead	3.0		200	196.8		ug/L		98	75 - 125

Lab Sample ID: 480-198760-2 MSD

Matrix: Ground Water

Analysis Batch: 629775

Client Sample ID: MW-1

Prep Type: Total/NA

Prep Batch: 629261

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Cadmium	5.0		200	195.2		ug/L		98	75 - 125	0	20
Chromium	10.0		200	185.2		ug/L		93	75 - 125	0	20
Lead	3.0		200	196.6		ug/L		98	75 - 125	0	20

Lab Sample ID: MB 480-629262/1-A

Matrix: Water

Analysis Batch: 629561

Client Sample ID: Method Blank

Prep Type: Total/NA

Prep Batch: 629262

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/09/22 13:09	06/10/22 01:18	1
Chromium	10.0	U	10.0		ug/L		06/09/22 13:09	06/10/22 01:18	1
Lead	3.0	U	3.0		ug/L		06/09/22 13:09	06/10/22 01:18	1

Lab Sample ID: LCS 480-629262/2-A

Matrix: Water

Analysis Batch: 629561

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Prep Batch: 629262

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Cadmium	200	200.3		ug/L		100	80 - 120
Chromium	200	201.6		ug/L		101	80 - 120
Lead	200	201.3		ug/L		101	80 - 120

Eurofins Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Method: 6010C - Metals (ICP) (Continued)

Lab Sample ID: MB 480-629422/1-A

Matrix: Water

Analysis Batch: 629560

Client Sample ID: Method Blank

Prep Type: Total Recoverable

Prep Batch: 629422

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/09/22 13:10	06/09/22 23:35	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/09/22 13:10	06/09/22 23:35	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/09/22 13:10	06/09/22 23:35	1

Lab Sample ID: LCS 480-629422/2-A

Matrix: Water

Analysis Batch: 629560

Client Sample ID: Lab Control Sample

Prep Type: Total Recoverable

Prep Batch: 629422

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Cadmium, Dissolved	200	198.7		ug/L		99	80 - 120
Chromium, Dissolved	200	197.3		ug/L		99	80 - 120
Lead, Dissolved	200	198.9		ug/L		99	80 - 120

Lab Sample ID: 480-198760-2 MS

Matrix: Ground Water

Analysis Batch: 629560

Client Sample ID: MW-1

Prep Type: Dissolved

Prep Batch: 629422

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Cadmium, Dissolved	5.0		200	197.6		ug/L		99	75 - 125
Chromium, Dissolved	10.0		200	192.9		ug/L		96	75 - 125
Lead, Dissolved	3.0		200	199.3		ug/L		100	75 - 125

Lab Sample ID: 480-198760-2 MSD

Matrix: Ground Water

Analysis Batch: 629560

Client Sample ID: MW-1

Prep Type: Dissolved

Prep Batch: 629422

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	Limit
Cadmium, Dissolved	5.0		200	204.7		ug/L		102	75 - 125	4	20
Chromium, Dissolved	10.0		200	199.6		ug/L		100	75 - 125	3	20
Lead, Dissolved	3.0		200	207.7		ug/L		104	75 - 125	4	20

QC Association Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

GC/MS VOA

Analysis Batch: 629687

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-198760-1	Dup	Total/NA	Ground Water	8260C	
480-198760-2	MW-1	Total/NA	Ground Water	8260C	
MB 480-629687/7	Method Blank	Total/NA	Water	8260C	
LCS 480-629687/5	Lab Control Sample	Total/NA	Water	8260C	
480-198760-2 MS	MW-1	Total/NA	Ground Water	8260C	
480-198760-2 MSD	MW-1	Total/NA	Ground Water	8260C	

Analysis Batch: 629695

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-198760-4	MW-12	Total/NA	Ground Water	8260C	
480-198760-5	MW-13	Total/NA	Ground Water	8260C	
480-198760-7	MW-1DA	Total/NA	Ground Water	8260C	
480-198760-14	MW-9	Total/NA	Ground Water	8260C	
480-198760-15	MW-9D	Total/NA	Ground Water	8260C	
MB 480-629695/9	Method Blank	Total/NA	Water	8260C	
LCS 480-629695/6	Lab Control Sample	Total/NA	Water	8260C	
LCSD 480-629695/7	Lab Control Sample Dup	Total/NA	Water	8260C	

Analysis Batch: 629936

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-198760-3	MW-11	Total/NA	Ground Water	8260C	
480-198760-6	MW-14	Total/NA	Ground Water	8260C	
480-198760-8	MW-2A	Total/NA	Ground Water	8260C	
480-198760-9	MW-3	Total/NA	Ground Water	8260C	
480-198760-10	MW-5	Total/NA	Ground Water	8260C	
480-198760-11	MW-6A	Total/NA	Ground Water	8260C	
480-198760-12	MW-6DA	Total/NA	Ground Water	8260C	
480-198760-13	MW-7	Total/NA	Ground Water	8260C	
480-198760-16	TRIP BLANK	Total/NA	Ground Water	8260C	
MB 480-629936/8	Method Blank	Total/NA	Water	8260C	
LCS 480-629936/5	Lab Control Sample	Total/NA	Water	8260C	
LCSD 480-629936/6	Lab Control Sample Dup	Total/NA	Water	8260C	

Metals

Prep Batch: 629261

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-198760-1	Dup	Total/NA	Ground Water	3005A	
480-198760-2	MW-1	Total/NA	Ground Water	3005A	
480-198760-3	MW-11	Total/NA	Ground Water	3005A	
480-198760-4	MW-12	Total/NA	Ground Water	3005A	
480-198760-5	MW-13	Total/NA	Ground Water	3005A	
480-198760-6	MW-14	Total/NA	Ground Water	3005A	
480-198760-7	MW-1DA	Total/NA	Ground Water	3005A	
480-198760-8	MW-2A	Total/NA	Ground Water	3005A	
480-198760-9	MW-3	Total/NA	Ground Water	3005A	
480-198760-10	MW-5	Total/NA	Ground Water	3005A	
480-198760-11	MW-6A	Total/NA	Ground Water	3005A	
480-198760-12	MW-6DA	Total/NA	Ground Water	3005A	
480-198760-13	MW-7	Total/NA	Ground Water	3005A	
480-198760-14	MW-9	Total/NA	Ground Water	3005A	

Eurofins Buffalo

QC Association Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Metals (Continued)

Prep Batch: 629261 (Continued)

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
MB 480-629261/1-A	Method Blank	Total/NA	Water	3005A	
LCS 480-629261/2-A	Lab Control Sample	Total/NA	Water	3005A	
480-198760-2 MS	MW-1	Total/NA	Ground Water	3005A	
480-198760-2 MSD	MW-1	Total/NA	Ground Water	3005A	

Prep Batch: 629262

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-198760-15	MW-9D	Total/NA	Ground Water	3005A	
MB 480-629262/1-A	Method Blank	Total/NA	Water	3005A	
LCS 480-629262/2-A	Lab Control Sample	Total/NA	Water	3005A	

Prep Batch: 629422

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-198760-1	Dup	Dissolved	Ground Water	3005A	
480-198760-2	MW-1	Dissolved	Ground Water	3005A	
480-198760-3	MW-11	Dissolved	Ground Water	3005A	
480-198760-4	MW-12	Dissolved	Ground Water	3005A	
480-198760-5	MW-13	Dissolved	Ground Water	3005A	
480-198760-6	MW-14	Dissolved	Ground Water	3005A	
480-198760-7	MW-1DA	Dissolved	Ground Water	3005A	
480-198760-8	MW-2A	Dissolved	Ground Water	3005A	
480-198760-9	MW-3	Dissolved	Ground Water	3005A	
480-198760-10	MW-5	Dissolved	Ground Water	3005A	
480-198760-11	MW-6A	Dissolved	Ground Water	3005A	
480-198760-12	MW-6DA	Dissolved	Ground Water	3005A	
480-198760-13	MW-7	Dissolved	Ground Water	3005A	
480-198760-14	MW-9	Dissolved	Ground Water	3005A	
480-198760-15	MW-9D	Dissolved	Ground Water	3005A	
MB 480-629422/1-A	Method Blank	Total Recoverable	Water	3005A	
LCS 480-629422/2-A	Lab Control Sample	Total Recoverable	Water	3005A	
480-198760-2 MS	MW-1	Dissolved	Ground Water	3005A	
480-198760-2 MSD	MW-1	Dissolved	Ground Water	3005A	

Analysis Batch: 629560

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-198760-1	Dup	Dissolved	Ground Water	6010C	629422
480-198760-2	MW-1	Dissolved	Ground Water	6010C	629422
480-198760-3	MW-11	Dissolved	Ground Water	6010C	629422
480-198760-4	MW-12	Dissolved	Ground Water	6010C	629422
480-198760-5	MW-13	Dissolved	Ground Water	6010C	629422
480-198760-6	MW-14	Dissolved	Ground Water	6010C	629422
480-198760-7	MW-1DA	Dissolved	Ground Water	6010C	629422
480-198760-8	MW-2A	Dissolved	Ground Water	6010C	629422
480-198760-9	MW-3	Dissolved	Ground Water	6010C	629422
480-198760-10	MW-5	Dissolved	Ground Water	6010C	629422
480-198760-11	MW-6A	Dissolved	Ground Water	6010C	629422
480-198760-12	MW-6DA	Dissolved	Ground Water	6010C	629422
480-198760-13	MW-7	Dissolved	Ground Water	6010C	629422
480-198760-14	MW-9	Dissolved	Ground Water	6010C	629422
480-198760-15	MW-9D	Dissolved	Ground Water	6010C	629422
MB 480-629422/1-A	Method Blank	Total Recoverable	Water	6010C	629422

Eurofins Buffalo

QC Association Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Metals (Continued)

Analysis Batch: 629560 (Continued)

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
LCS 480-629422/2-A	Lab Control Sample	Total Recoverable	Water	6010C	629422
480-198760-2 MS	MW-1	Dissolved	Ground Water	6010C	629422
480-198760-2 MSD	MW-1	Dissolved	Ground Water	6010C	629422

Analysis Batch: 629561

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-198760-15	MW-9D	Total/NA	Ground Water	6010C	629262
MB 480-629262/1-A	Method Blank	Total/NA	Water	6010C	629262
LCS 480-629262/2-A	Lab Control Sample	Total/NA	Water	6010C	629262

Analysis Batch: 629775

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-198760-1	Dup	Total/NA	Ground Water	6010C	629261
480-198760-2	MW-1	Total/NA	Ground Water	6010C	629261
480-198760-3	MW-11	Total/NA	Ground Water	6010C	629261
480-198760-4	MW-12	Total/NA	Ground Water	6010C	629261
480-198760-5	MW-13	Total/NA	Ground Water	6010C	629261
480-198760-6	MW-14	Total/NA	Ground Water	6010C	629261
480-198760-7	MW-1DA	Total/NA	Ground Water	6010C	629261
480-198760-8	MW-2A	Total/NA	Ground Water	6010C	629261
480-198760-9	MW-3	Total/NA	Ground Water	6010C	629261
480-198760-10	MW-5	Total/NA	Ground Water	6010C	629261
480-198760-11	MW-6A	Total/NA	Ground Water	6010C	629261
480-198760-12	MW-6DA	Total/NA	Ground Water	6010C	629261
480-198760-13	MW-7	Total/NA	Ground Water	6010C	629261
480-198760-14	MW-9	Total/NA	Ground Water	6010C	629261
MB 480-629261/1-A	Method Blank	Total/NA	Water	6010C	629261
LCS 480-629261/2-A	Lab Control Sample	Total/NA	Water	6010C	629261
480-198760-2 MS	MW-1	Total/NA	Ground Water	6010C	629261
480-198760-2 MSD	MW-1	Total/NA	Ground Water	6010C	629261

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: Dup

Date Collected: 06/03/22 09:27

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-1

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629687	06/11/22 20:40	CRL	TAL BUF
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/09/22 23:42	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 15:49	LMH	TAL BUF

Client Sample ID: MW-1

Date Collected: 06/03/22 10:30

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-2

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629687	06/11/22 21:02	CRL	TAL BUF
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/09/22 23:46	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 15:53	LMH	TAL BUF

Client Sample ID: MW-11

Date Collected: 06/06/22 09:53

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-3

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629936	06/14/22 18:31	CRL	TAL BUF
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/10/22 00:17	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 16:12	LMH	TAL BUF

Client Sample ID: MW-12

Date Collected: 06/03/22 09:27

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-4

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629695	06/12/22 06:11	CRL	TAL BUF
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/10/22 00:20	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 16:16	LMH	TAL BUF

Client Sample ID: MW-13

Date Collected: 06/03/22 08:26

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-5

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629695	06/12/22 06:34	CRL	TAL BUF

Eurofins Buffalo

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-13

Date Collected: 06/03/22 08:26

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-5

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/10/22 00:24	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 16:20	LMH	TAL BUF

Client Sample ID: MW-14

Date Collected: 06/06/22 08:44

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-6

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629936	06/14/22 18:53	CRL	TAL BUF
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/10/22 00:28	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 16:35	LMH	TAL BUF

Client Sample ID: MW-1DA

Date Collected: 06/03/22 12:18

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-7

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629695	06/12/22 06:56	CRL	TAL BUF
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/10/22 00:32	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 16:39	LMH	TAL BUF

Client Sample ID: MW-2A

Date Collected: 06/06/22 12:49

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-8

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629936	06/14/22 19:14	CRL	TAL BUF
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/10/22 00:47	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 16:43	LMH	TAL BUF

Client Sample ID: MW-3

Date Collected: 06/06/22 10:36

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-9

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629936	06/14/22 19:36	CRL	TAL BUF

Eurofins Buffalo

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-3

Date Collected: 06/06/22 10:36

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-9

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/10/22 00:51	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 16:47	LMH	TAL BUF

Client Sample ID: MW-5

Date Collected: 06/07/22 09:55

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-10

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629936	06/14/22 19:58	CRL	TAL BUF
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/10/22 00:55	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 16:50	LMH	TAL BUF

Client Sample ID: MW-6A

Date Collected: 06/06/22 13:34

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-11

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629936	06/14/22 20:20	CRL	TAL BUF
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/10/22 00:59	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 16:54	LMH	TAL BUF

Client Sample ID: MW-6DA

Date Collected: 06/06/22 15:00

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-12

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629936	06/14/22 20:42	CRL	TAL BUF
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/10/22 01:03	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 16:58	LMH	TAL BUF

Client Sample ID: MW-7

Date Collected: 06/06/22 11:23

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-13

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629936	06/14/22 21:04	CRL	TAL BUF

Eurofins Buffalo

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Client Sample ID: MW-7

Date Collected: 06/06/22 11:23

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-13

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/10/22 01:07	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 17:02	LMH	TAL BUF

Client Sample ID: MW-9

Date Collected: 06/03/22 13:34

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-14

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629695	06/12/22 07:17	CRL	TAL BUF
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/10/22 01:10	LMH	TAL BUF
Total/NA	Prep	3005A			629261	06/10/22 08:52	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629775	06/10/22 17:06	LMH	TAL BUF

Client Sample ID: MW-9D

Date Collected: 06/03/22 14:58

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-15

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629695	06/12/22 07:40	CRL	TAL BUF
Dissolved	Prep	3005A			629422	06/09/22 13:10	NVK	TAL BUF
Dissolved	Analysis	6010C		1	629560	06/10/22 01:14	LMH	TAL BUF
Total/NA	Prep	3005A			629262	06/09/22 13:09	VAK	TAL BUF
Total/NA	Analysis	6010C		1	629561	06/10/22 02:27	LMH	TAL BUF

Client Sample ID: TRIP BLANK

Date Collected: 06/06/22 14:30

Date Received: 06/07/22 11:20

Lab Sample ID: 480-198760-16

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8260C		1	629936	06/14/22 21:26	CRL	TAL BUF

Laboratory References:

TAL BUF = Eurofins Buffalo, 10 Hazelwood Drive, Amherst, NY 14228-2298, TEL (716)691-2600

Eurofins Buffalo

Accreditation/Certification Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Laboratory: Eurofins Buffalo

Unless otherwise noted, all analytes for this laboratory were covered under each accreditation/certification below.

Authority	Program	Identification Number	Expiration Date
New York	NELAP	10026	03-31-23

The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.

Analysis Method	Prep Method	Matrix	Analyte
8260C		Ground Water	1,2-Dichloroethene, Total

Method Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Method	Method Description	Protocol	Laboratory
8260C	Volatile Organic Compounds by GC/MS	SW846	TAL BUF
6010C	Metals (ICP)	SW846	TAL BUF
3005A	Preparation, Total Metals	SW846	TAL BUF
3005A	Preparation, Total Recoverable or Dissolved Metals	SW846	TAL BUF
5030C	Purge and Trap	SW846	TAL BUF

Protocol References:

SW846 = "Test Methods For Evaluating Solid Waste, Physical/Chemical Methods", Third Edition, November 1986 And Its Updates.

Laboratory References:

TAL BUF = Eurofins Buffalo, 10 Hazelwood Drive, Amherst, NY 14228-2298, TEL (716)691-2600

Sample Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

Lab Sample ID	Client Sample ID	Matrix	Collected	Received
480-198760-1	Dup	Ground Water	06/03/22 09:27	06/07/22 11:20
480-198760-2	MW-1	Ground Water	06/03/22 10:30	06/07/22 11:20
480-198760-3	MW-11	Ground Water	06/06/22 09:53	06/07/22 11:20
480-198760-4	MW-12	Ground Water	06/03/22 09:27	06/07/22 11:20
480-198760-5	MW-13	Ground Water	06/03/22 08:26	06/07/22 11:20
480-198760-6	MW-14	Ground Water	06/06/22 08:44	06/07/22 11:20
480-198760-7	MW-1DA	Ground Water	06/03/22 12:18	06/07/22 11:20
480-198760-8	MW-2A	Ground Water	06/06/22 12:49	06/07/22 11:20
480-198760-9	MW-3	Ground Water	06/06/22 10:36	06/07/22 11:20
480-198760-10	MW-5	Ground Water	06/07/22 09:55	06/07/22 11:20
480-198760-11	MW-6A	Ground Water	06/06/22 13:34	06/07/22 11:20
480-198760-12	MW-6DA	Ground Water	06/06/22 15:00	06/07/22 11:20
480-198760-13	MW-7	Ground Water	06/06/22 11:23	06/07/22 11:20
480-198760-14	MW-9	Ground Water	06/03/22 13:34	06/07/22 11:20
480-198760-15	MW-9D	Ground Water	06/03/22 14:58	06/07/22 11:20
480-198760-16	TRIP BLANK	Ground Water	06/06/22 14:30	06/07/22 11:20

Quantitation Limit Exceptions Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-198760-1

The requested project specific reporting limits listed below were less than laboratory standard quantitation limits (PQL) but greater than or equal to the laboratory method detection limits (MDL). It must be noted that results reported below lab standard quantitation limits may result in false positive/false negative values and less accurate quantitation. Routine laboratory procedures do not indicate corrective action for detections below the laboratory's PQL.

Method	Analyte	Matrix	Prep Type	Unit	Client RL	Lab PQL
6010C	Lead	Ground Water	Total/NA	ug/L	3.0	10
6010C	Lead, Dissolved	Ground Water	Dissolved	ug/L	3.0	10

Eurofins Buffalo

10 Hazelwood Drive

Amherst, NY 14228-2298

Phone: 716-691-2600 Fax: 716-691-7991

Chain of Custody Record

Environment Testing
America

Client Information		Sampler: ALT KOSKE		Lab PM: Fischer, Brian J		Carrier Tracking No(s):		COC No: 480-174271-193311	
Client Contact: Patrick Allenstein		Phone:		E-Mail: Brian.Fischer@eurofins.com		State of Origin: NY		Page 1 of 2	
Company: KPRG and Associates, Inc.		PWSID:		Analysis Requested		Job #:			
Address: 14665 West Lisbon Road, Suite 1A		Due Date Requested:		TAT Requested (days):		Compliance Project: ☐ Yes ☒ No		Purchase Order not required	
City: Brookfield		State: WI		Zip: 53005		PO #:		WO #:	
Phone: 262-781-0475(Tel)		E-Mail: patricka@kprginc.com		Project #:		48002774		SSOW #:	
Project Name: Prestolite site/ Event Desc: Prestolite site		Site: New York		Sample Identification		Sample Date		Sample Time	
Matrix (W=Water, S=Solid, O=Seawater, BT=Tissue, A=Air)		Sample Type (C=Comp, G=Grab)		Preservation Code:		Field Filtered Sample (Yes or No)		Perform MS/MSD (Yes or No)	
8260C - (MOD) Local Method		6010C - T, Cd/Cr/Pb (ICP)		6010C - D, Cd/Cr/Pb (ICP)		Total Number of containers		Special Instructions/Note:	
MW-1		6-3-22		10:30		G		Water	
MW-11		6-6-22		9:53				Water	
MW-12		6-3-22		9:27				Water	
MW-13		6-3-22		8:26				Water	
MW-14		6-6-22		8:44				Water	
MW-1DA		6-3-22		12:18				Water	
MW-2A		6-6-22		12:49				Water	
MW-3		6-6-22		10:36				Water	
MW-5		6-7-22		9:55				Water	
MW-6A		6-6-22		13:34				Water	
MW-6DA		6-6-22		15:00				Water	
Possible Hazard Identification		☒ Non-Hazard ☐ Flammable ☐ Skin Irritant ☐ Poison B ☐ Unknown ☐ Radiological		Empty Kit Relinquished by:		Date:		Time:	
Deliverable Requested: I, II, III, IV, Other (specify)		Relinquished by: <i>[Signature]</i>		Date/Time: 6/7/22 11:20		Company: 523		Received by:	
Relinquished by:		Date/Time:		Company:		Received by:		Date/Time:	
Relinquished by:		Date/Time:		Company:		Received by: <i>[Signature]</i>		Date/Time: 6/7/22 11:20	
Custody Seals Intact: ☐ Yes ☒ No		Custody Seal No: 34, 41 #1		Cooler Temperature(s) °C and Other Remarks: 3.4, 4.1		Company: T6413		Date/Time: 6/7/22 11:20	

10 Hazelwood Drive
Amherst, NY 14228-2298
Phone: 716-691-2600 Fax: 716-691-7991

Chain of Custody Record

Client Information						Lab PM:						Carrier Tracking Note(s)						COC No.
Patrick Allenstein KPRG and Associates, Inc. Address: 14665 West Lisbon Road, Suite 1A City: Brookfield State, Zip: WI, 53005 Phone: 262-781-0475(Tel) Email: patricka@kprginc.com Project Name: Prestolite site/ Event Desc: Prestolite site Site: New York						Fischer, Brian J E-Mail: Brian.Fischer@et.eurofinsus.com Page 2 of 2												480-174271-193312
Possible Hazard Identification																		
☒ Non-Hazard ☐ Flammable ☐ Skin Irritant ☐ Poison B ☐ Unknown ☐ Radiological																		
Deliverable Requested: I, II, III, IV, Other (specify) _____																		
Sample Disposal (A fee may be assessed if samples are retained longer than 1 month)																		
☐ Return To Client ☒ Dispose By Lab ☐ Archive For _____ Months																		
Special Instructions/QC Requirements:																		
Empty Kit Relinquished by: _____ Date: _____ Relinquished by: _____ Date/Time: _____ Company: SSB Relinquished by: _____ Date/Time: _____ Company: Relinquished by: _____ Date/Time: _____ Company:																		
Custody Seals Intact: ☒ Yes ☐ No																		
Cooler Temperature(s) _____ and Other Remarks _____																		

Login Sample Receipt Checklist

Client: KPRG and Associates, Inc.

Job Number: 480-198760-1


Login Number: 198760

List Source: Eurofins Buffalo

List Number: 1


Creator: Sabuda, Brendan D

Question	Answer	Comment
Radioactivity either was not measured or, if measured, is at or below background	True	
The cooler's custody seal, if present, is intact.	True	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	True	
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	True	3.4 4.1 #1 ICE
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the sample IDs on the containers and the COC.	True	
Samples are received within Holding Time (Excluding tests with immediate HTs)..	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified	True	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
VOA sample vials do not have headspace or bubble is <6mm (1/4") in diameter.	True	
If necessary, staff have been informed of any short hold time or quick TAT needs	True	
Multiphasic samples are not present.	True	
Samples do not require splitting or compositing.	True	
Sampling Company provided.	True	
Samples received within 48 hours of sampling.	False	
Samples requiring field filtration have been filtered in the field.	True	
Chlorine Residual checked.	True	




Gals./well vol.: .9 / 2.8

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	




Gals./well vol.: 5.0/15.1

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	




Gals./well vol.: 23 / 69

HNu/PPM	LEL/%	OL/%	H ₂ S/PPM	CO/PPM	



HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Volume Calculation:

Gals./well vol.: 3.1/9.3

(Gals./well vol. x 5 = Total Volume to be removed)

Comments: WELL IN GOOD CONDITION


Field Blank Taken ☐ Time: _____

Well Duplicate ☒ No:

Signature: 


Date: 6/7/22

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	




Gals./well vol.: 58 / 1.7

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Gals./well vol.: 6.6 / 19.7

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Gals./well vol.: 6/1.9

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Well Purging and Sample Collection

Project No.: _____ Well No. MW-9 Site: PRESTOLITE

Purging Method: Pumped ☒ Bailed ☐ Other: _____

Pump Type: _____ Bailer Type: 2"

Weather Conditions: SUNNY 67°

Volume Calculation: _____

(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)

(Gals./well vol. x 5 = Total Volume to be removed)

Gals./well vol.: 1.8 / 5.3

Time	Depth to Water (D.T.W.)	Depth to Bottom (D.T.B.)	Volume Removed (gal.)	pH	Cond.	Temp.	Color	Odor Y/N	Turbidity
12:47	11.96	22.95	22.95 0	7.69	657	66.2	BROWN	NO	OPAQUE
12:53			1	7.58	623	63.5	BROWN	NO	TRANSLUCENT
12:57			2	7.61	594	63.9	BROWN	NO	OPAQUE
13:02			3	7.56	592	64.0	LT TAN	NO	TRANSPARENT
13:08			4	7.51	589	63.4	LT TAN	NO	TRANSPARENT
13:14			5	7.54	592	63.8	LT TAN	NO	TRANSPARENT
13:19			6	7.46	585	63.9	LT BROWN	NO	OPAQUE
13:24			7	7.46	587	63.8	LT TAN	NO	TRANSLUCENT
13:29			8	7.50	589	63.8	LT TAN	NO	TRANSPARENT
13:34			9	7.48	586	63.9	LT BROWN	NO	OPAQUE
Sample Readings									

Comments: WELL IN GOOD CONDITION

Inside Diameter	vol./ft.
1"	0.04
1.25"	0.06
2"	0.16
4"	0.65


Field Blank Taken ☐ Time: _____

Well Duplicate ☐ No.: _____

Signature: [Signature]

Date: 6/3/22

HNu/PPM	LEL/%	O2/%	H2S/PPM	CO/PPM	



Gals./well vol.: 2.1 / 6.2

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Well Purging and Sample Collection

Project No.: _____ Well No. MW-13 Site: PRESTOLITE

Purging Method: Pumped ☒ Bailed ☐ Other: _____

Pump Type: CLAYTON 520 Bailer Type: 2"

Weather Conditions: CLOUDY 52°

Volume Calculation: _____

(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)

(Gals./well vol. x 5 = Total Volume to be removed)

Gals./well vol.: 1.6 / 4.8

Time	Depth to Water (D.T.W.)	Depth to Bottom (D.T.B.)	Volume Removed (gal.)	pH	Cond.	Temp.	Color	Odor Y/N	Turbidity
7:30	9.35	19.3	0	7.70	1106	56.3	TAN	NO	OPAQUE
8:02			.5	7.69	804	57.9	LT TAN	NO	TRANSLUCENT
8:05			1.0	7.79	751	56.3	CLEAR	NO	TRANSPARENT
8:07			1.5	7.72	754	55.7	CLEAR	NO	TRANSPARENT
8:09			2.0	7.82	764	55.7	CLEAR	NO	TRANSPARENT
8:11			2.5	7.73	768	55.7	CLEAR	NO	CLEAR
8:14			3.0	7.83	776	55.7	CLEAR	NO	CLEAR
8:18			3.5	7.61	763	55.6	CLEAR	NO	CLEAR
8:21			4.0	7.76	750	55.5	CLEAR	NO	CLEAR
8:23			4.5	7.75	779	55.6	CLEAR	NO	CLEAR
8:26		Sample Readings	5.0	7.71	758	55.6	CLEAR	NO	CLEAR

Comments: WELL NEEDS NEW CURB BOX

Inside Diameter	vol./ft.
1"	0.04
1.25"	0.06
2"	0.16
4"	0.65

Field Blank Taken ☐ Time: _____

Well Duplicate ☐ No.: _____


Signature: [Signature]

Date: 6 / 3 / 22

HNu/PPM	LEL/%	O2/%	H2S/PPM	CO/PPM	


ATTACHMENT 4
VOC Time vs. Concentration Curves

Concentration vs. Time - MW-01

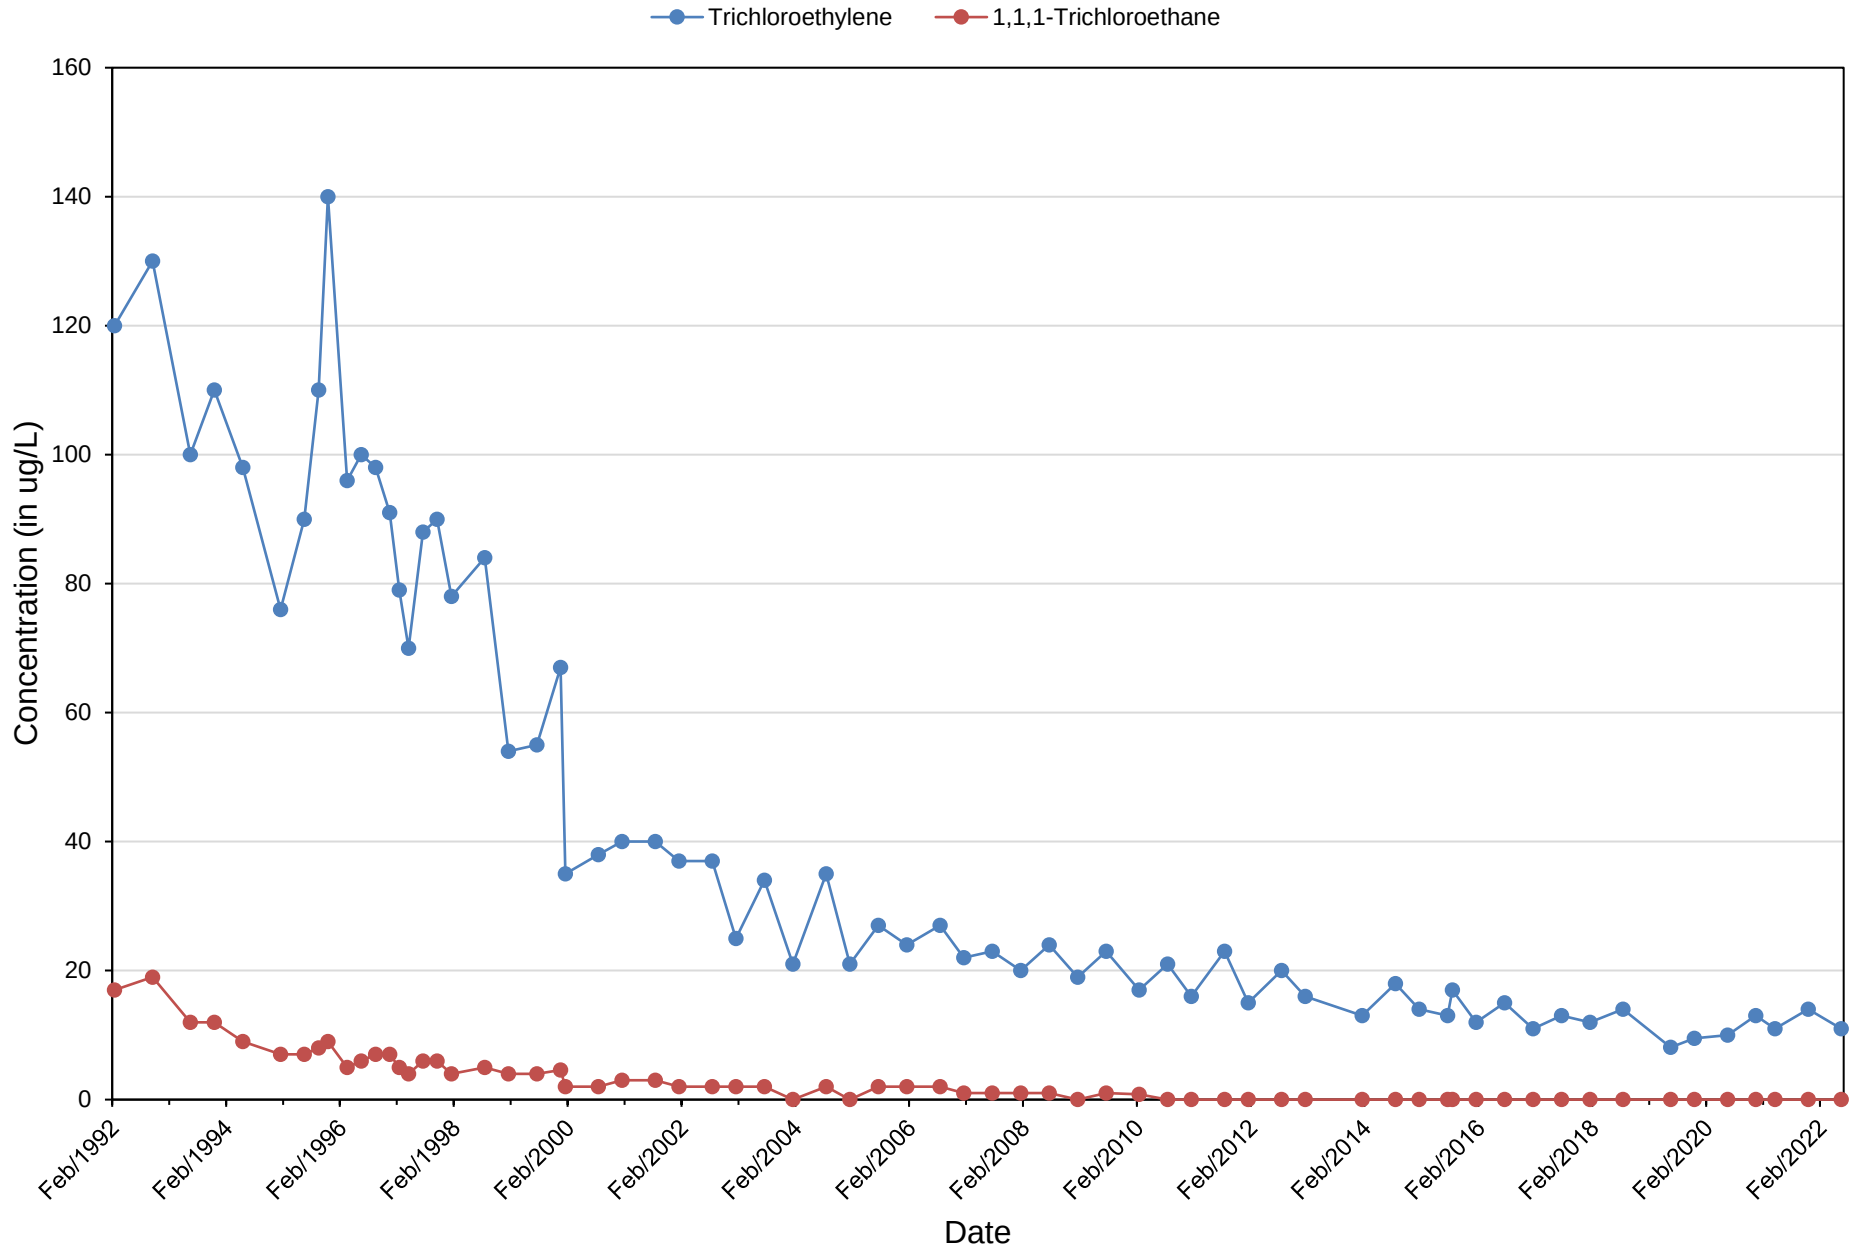


Concentration vs. Time - MW-01DA


Trichloroethylene 1,1,1-Trichloroethane

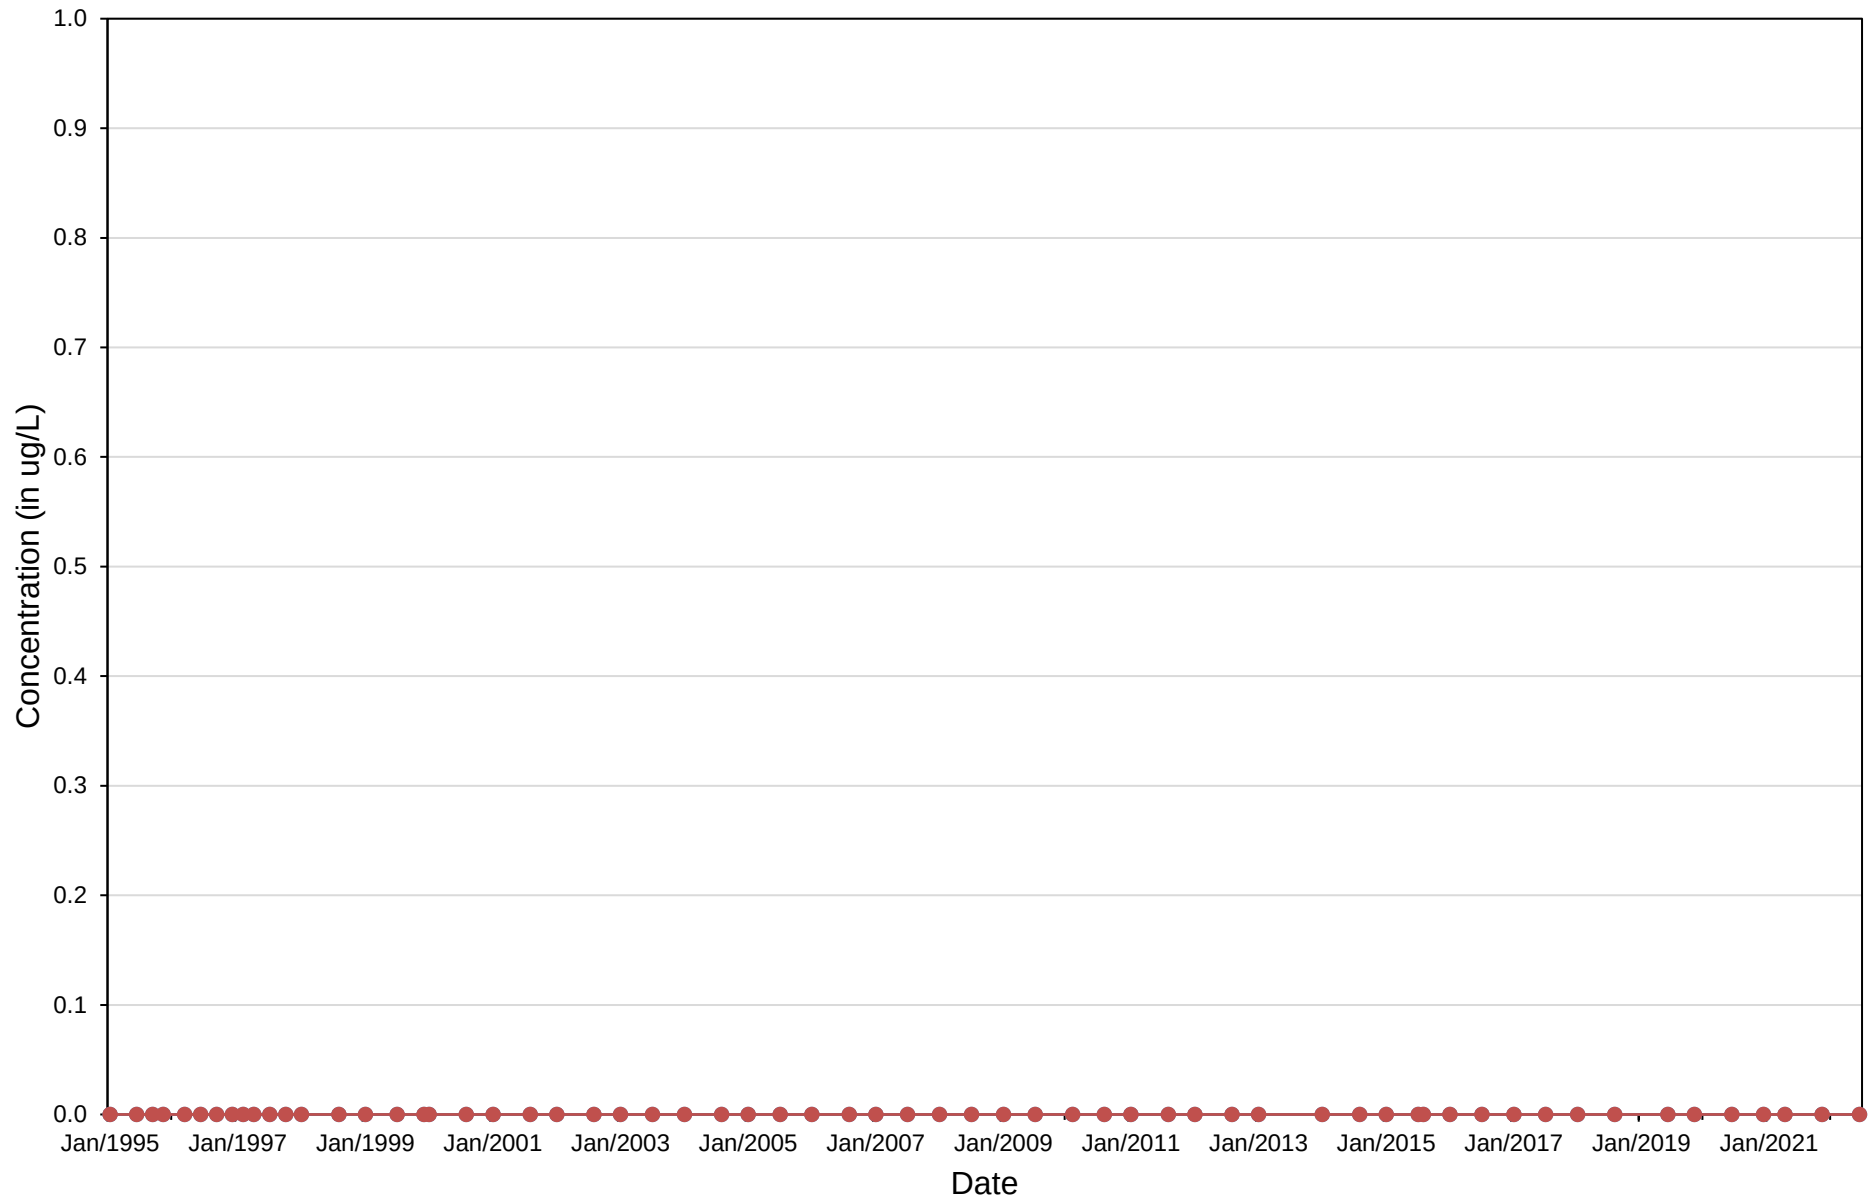

Concentration vs. Time - MW-02A

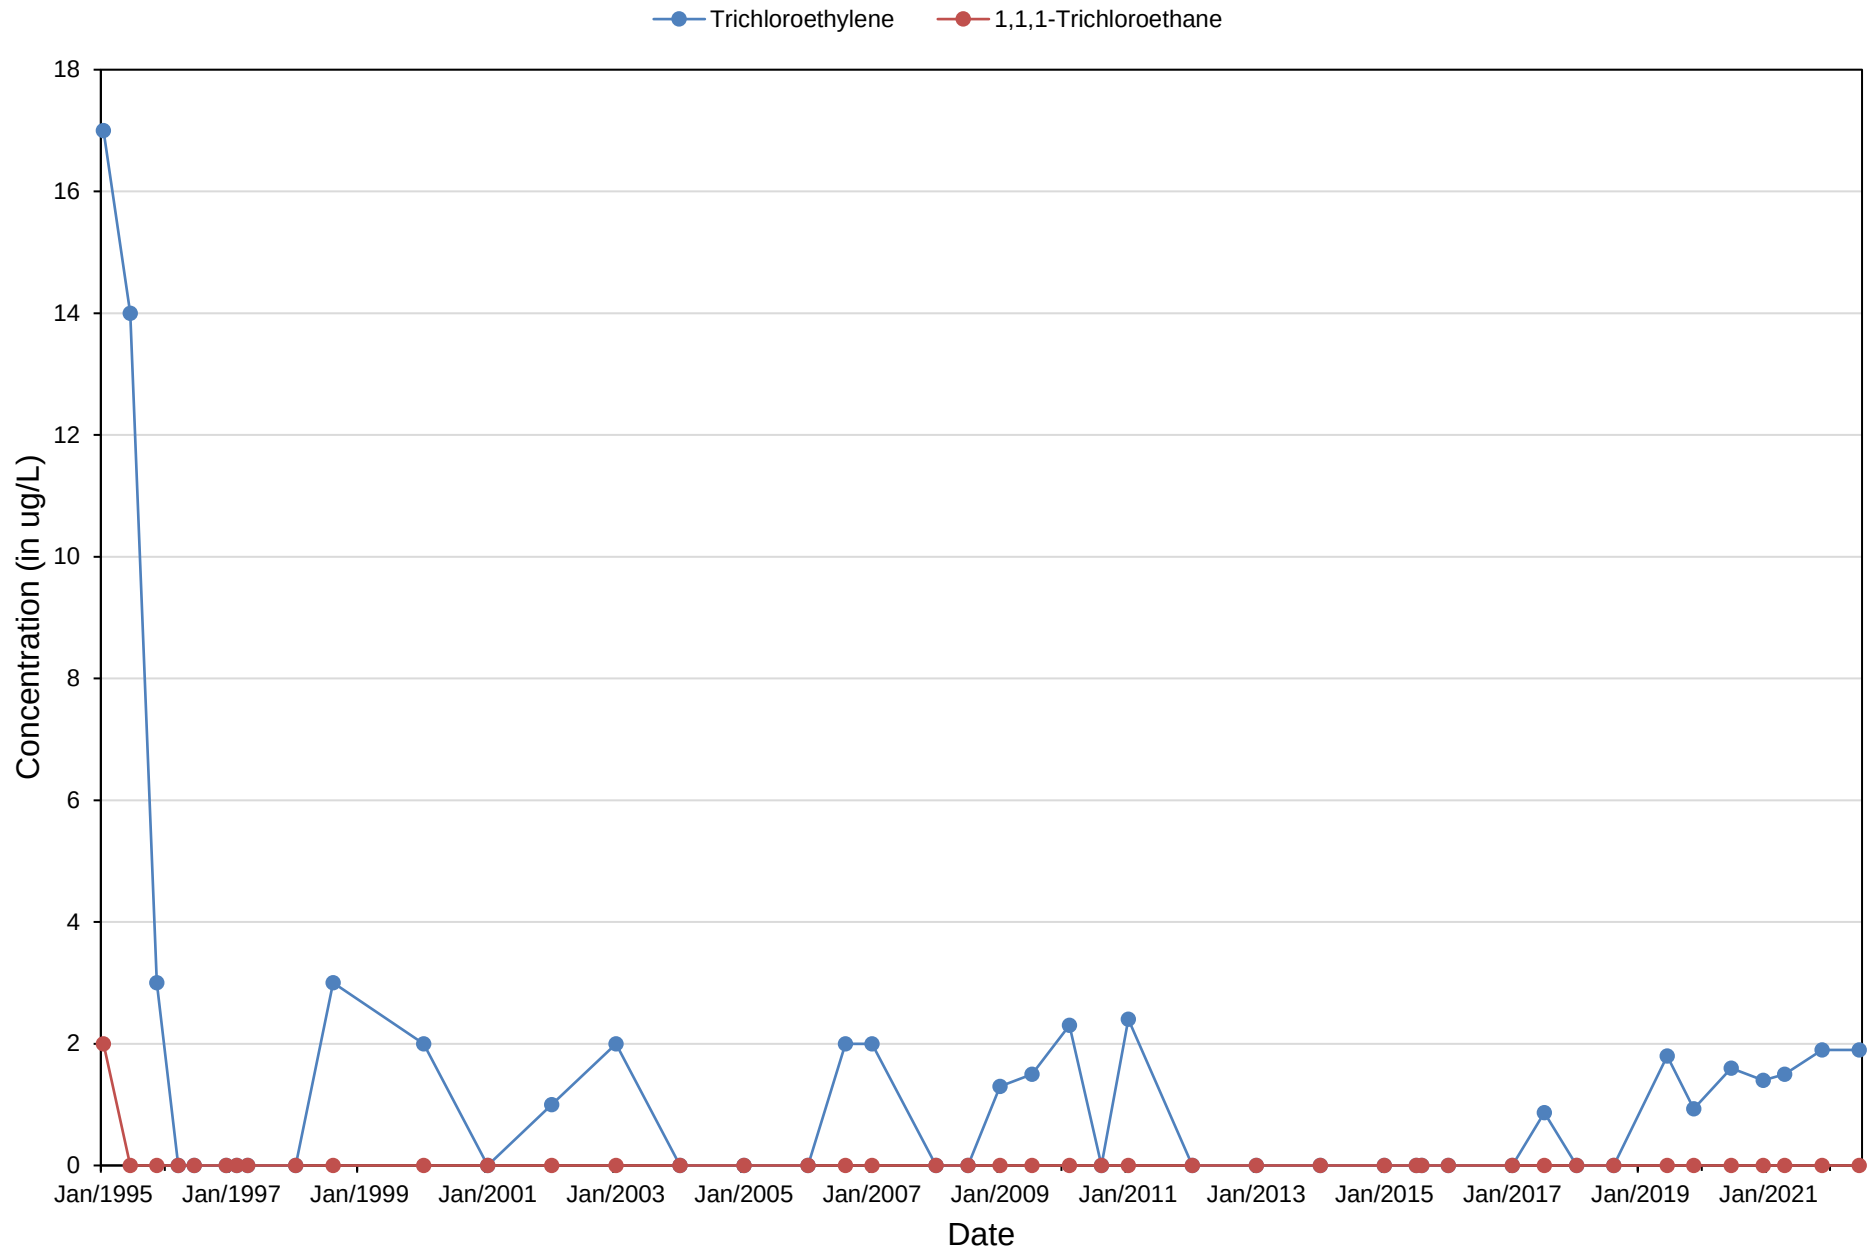


Concentration vs. Time - MW-03

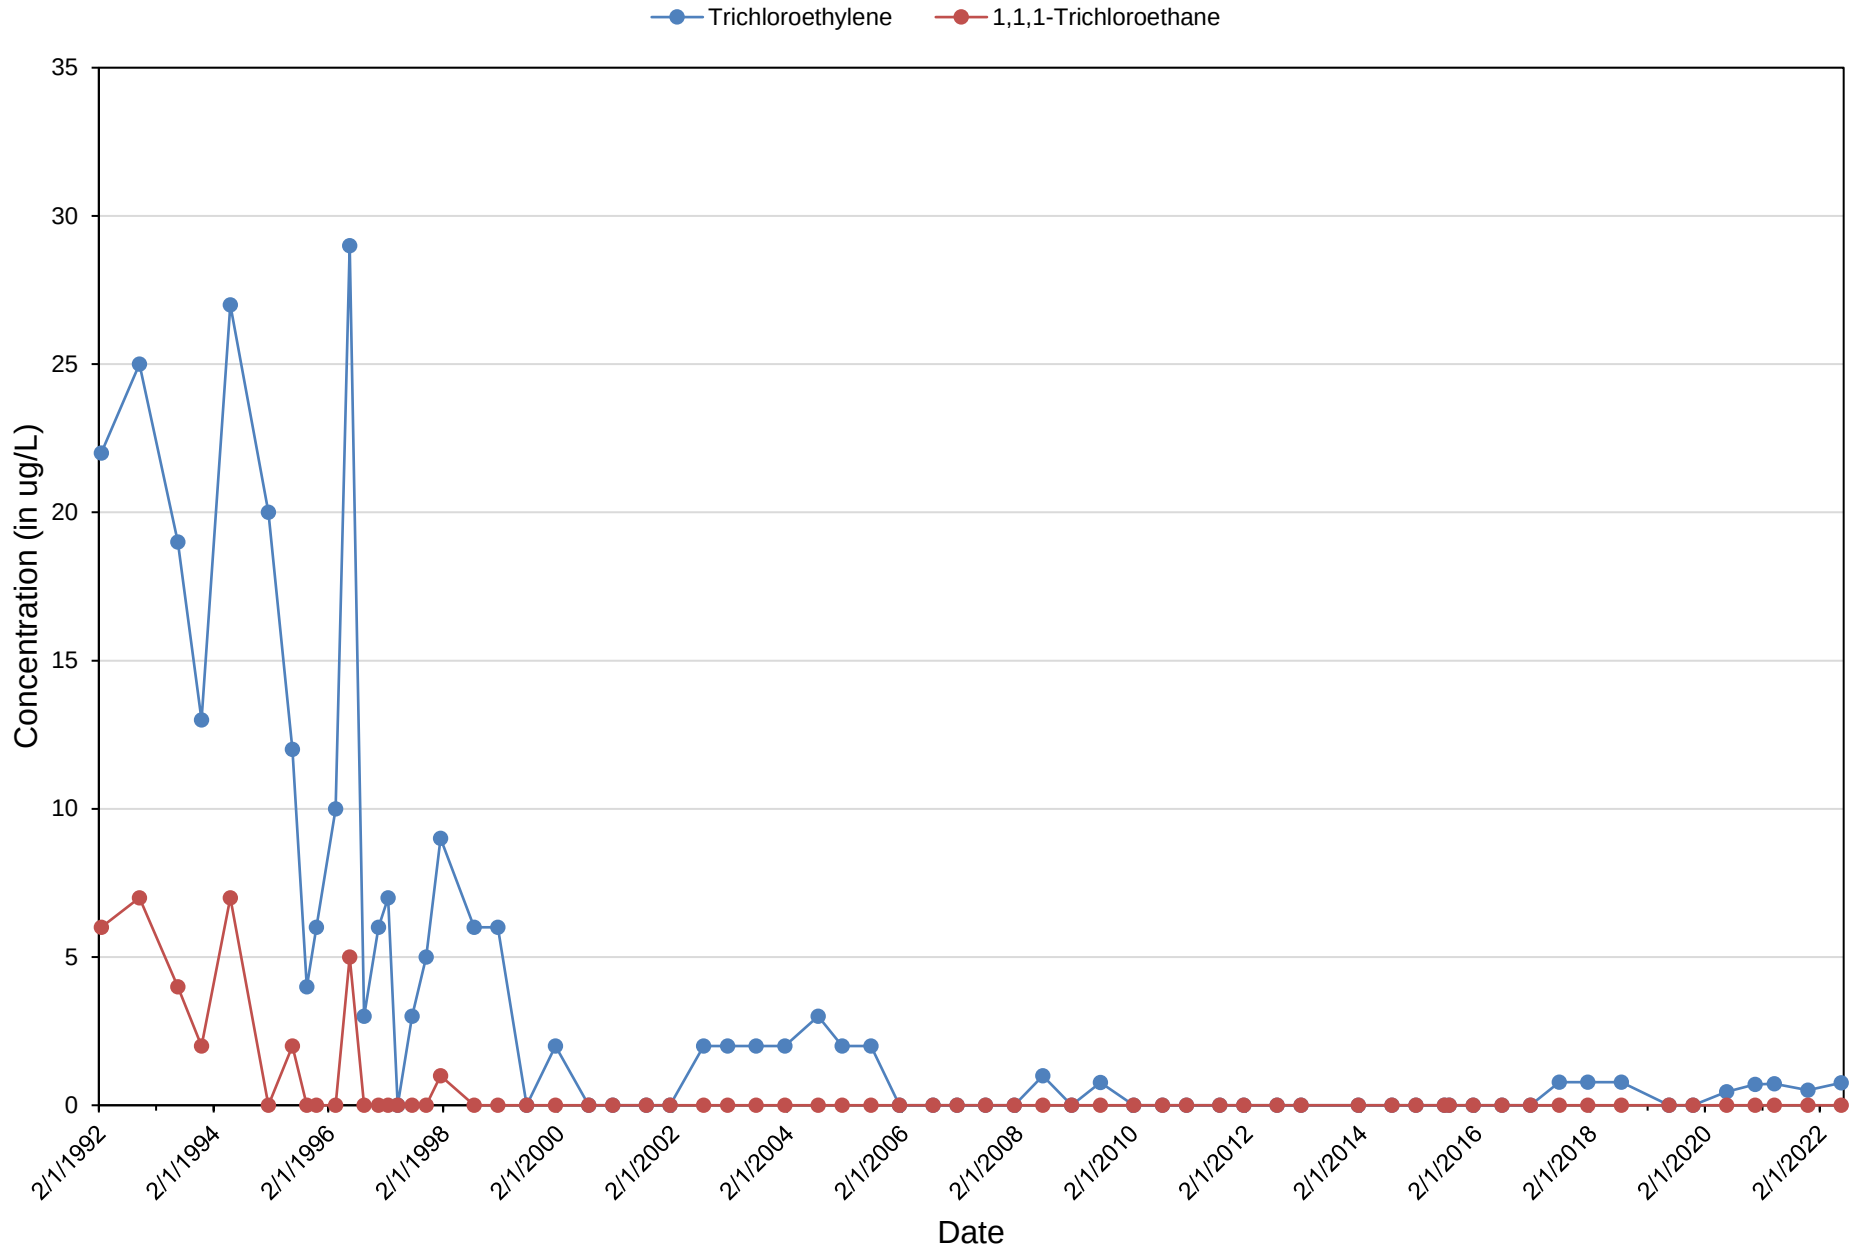


Concentration vs. Time - MW-05


Trichloroethylene 1,1,1-Trichloroethane

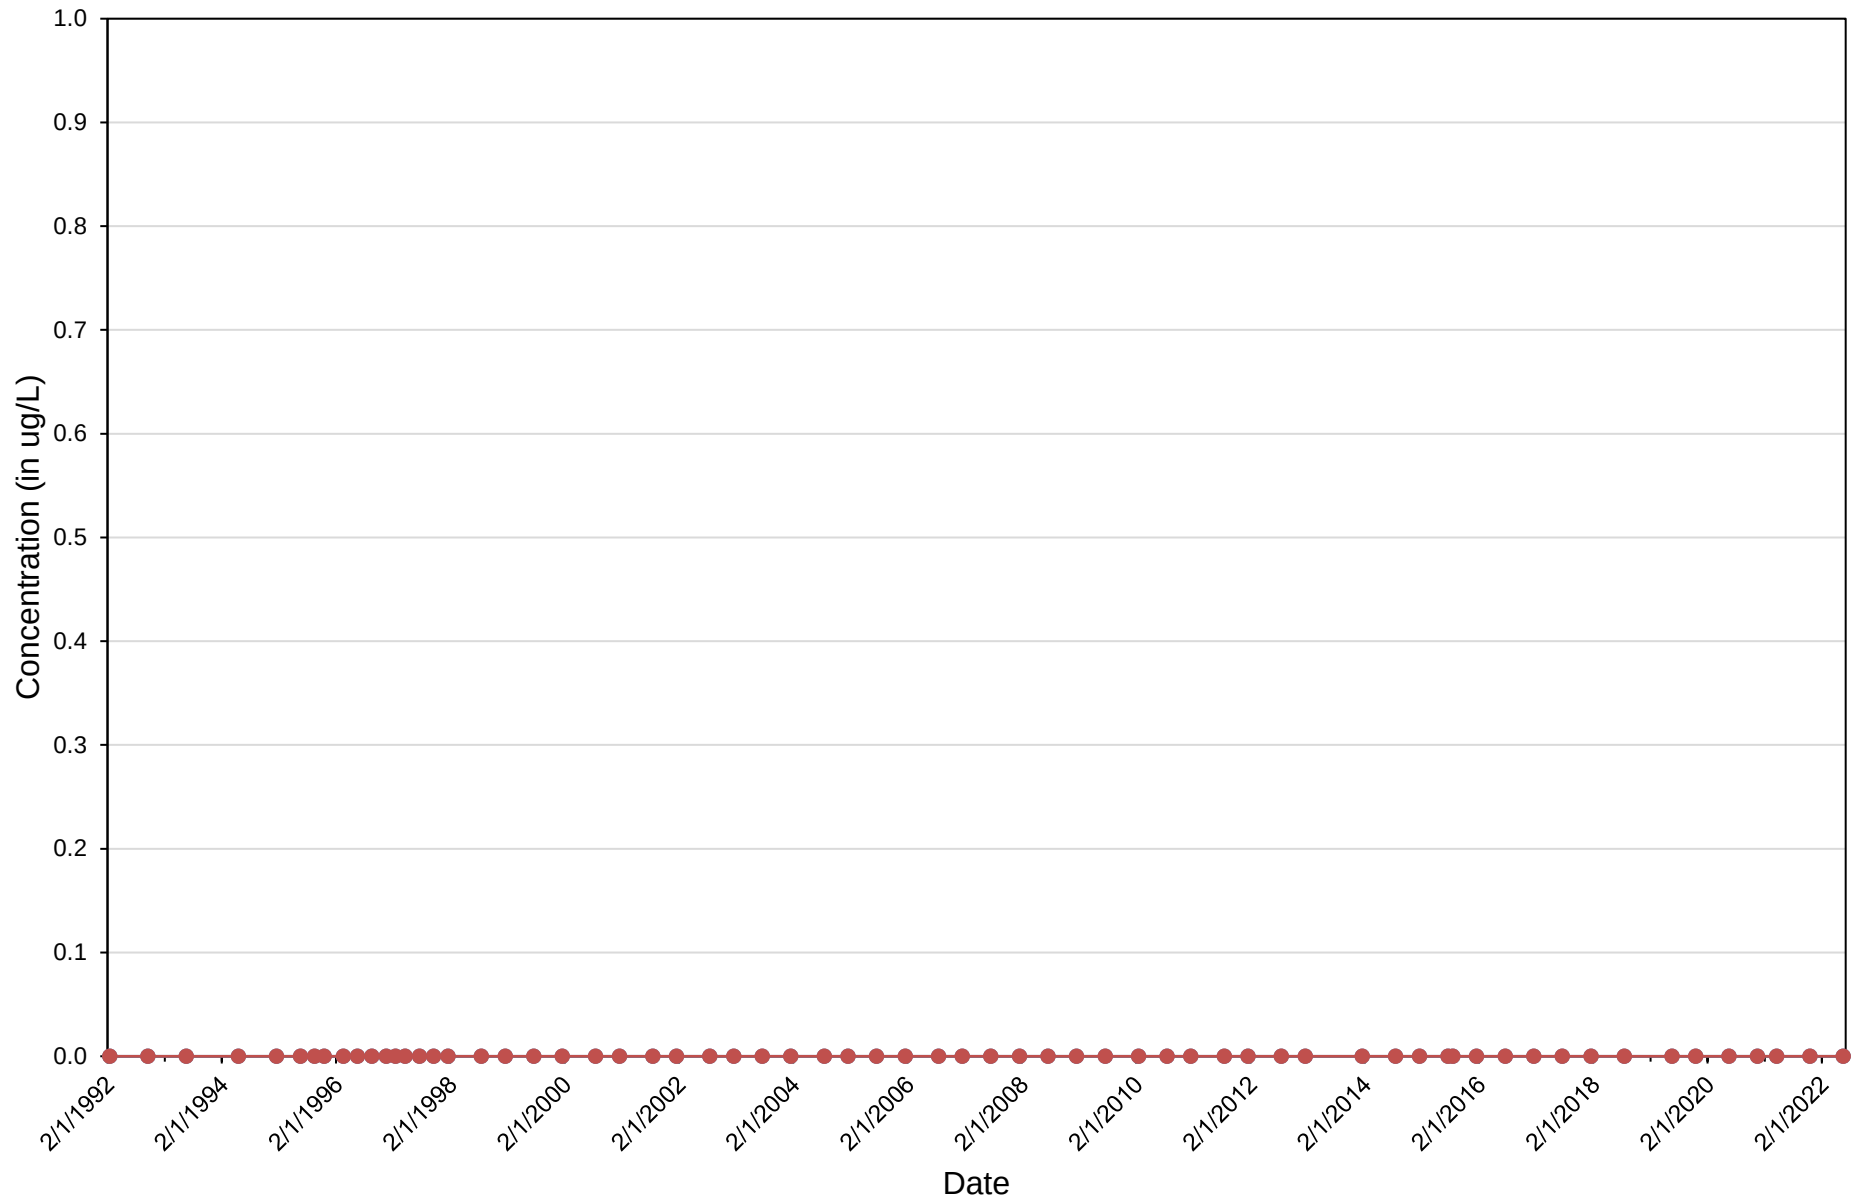


Concentration vs. Time - MW-06A

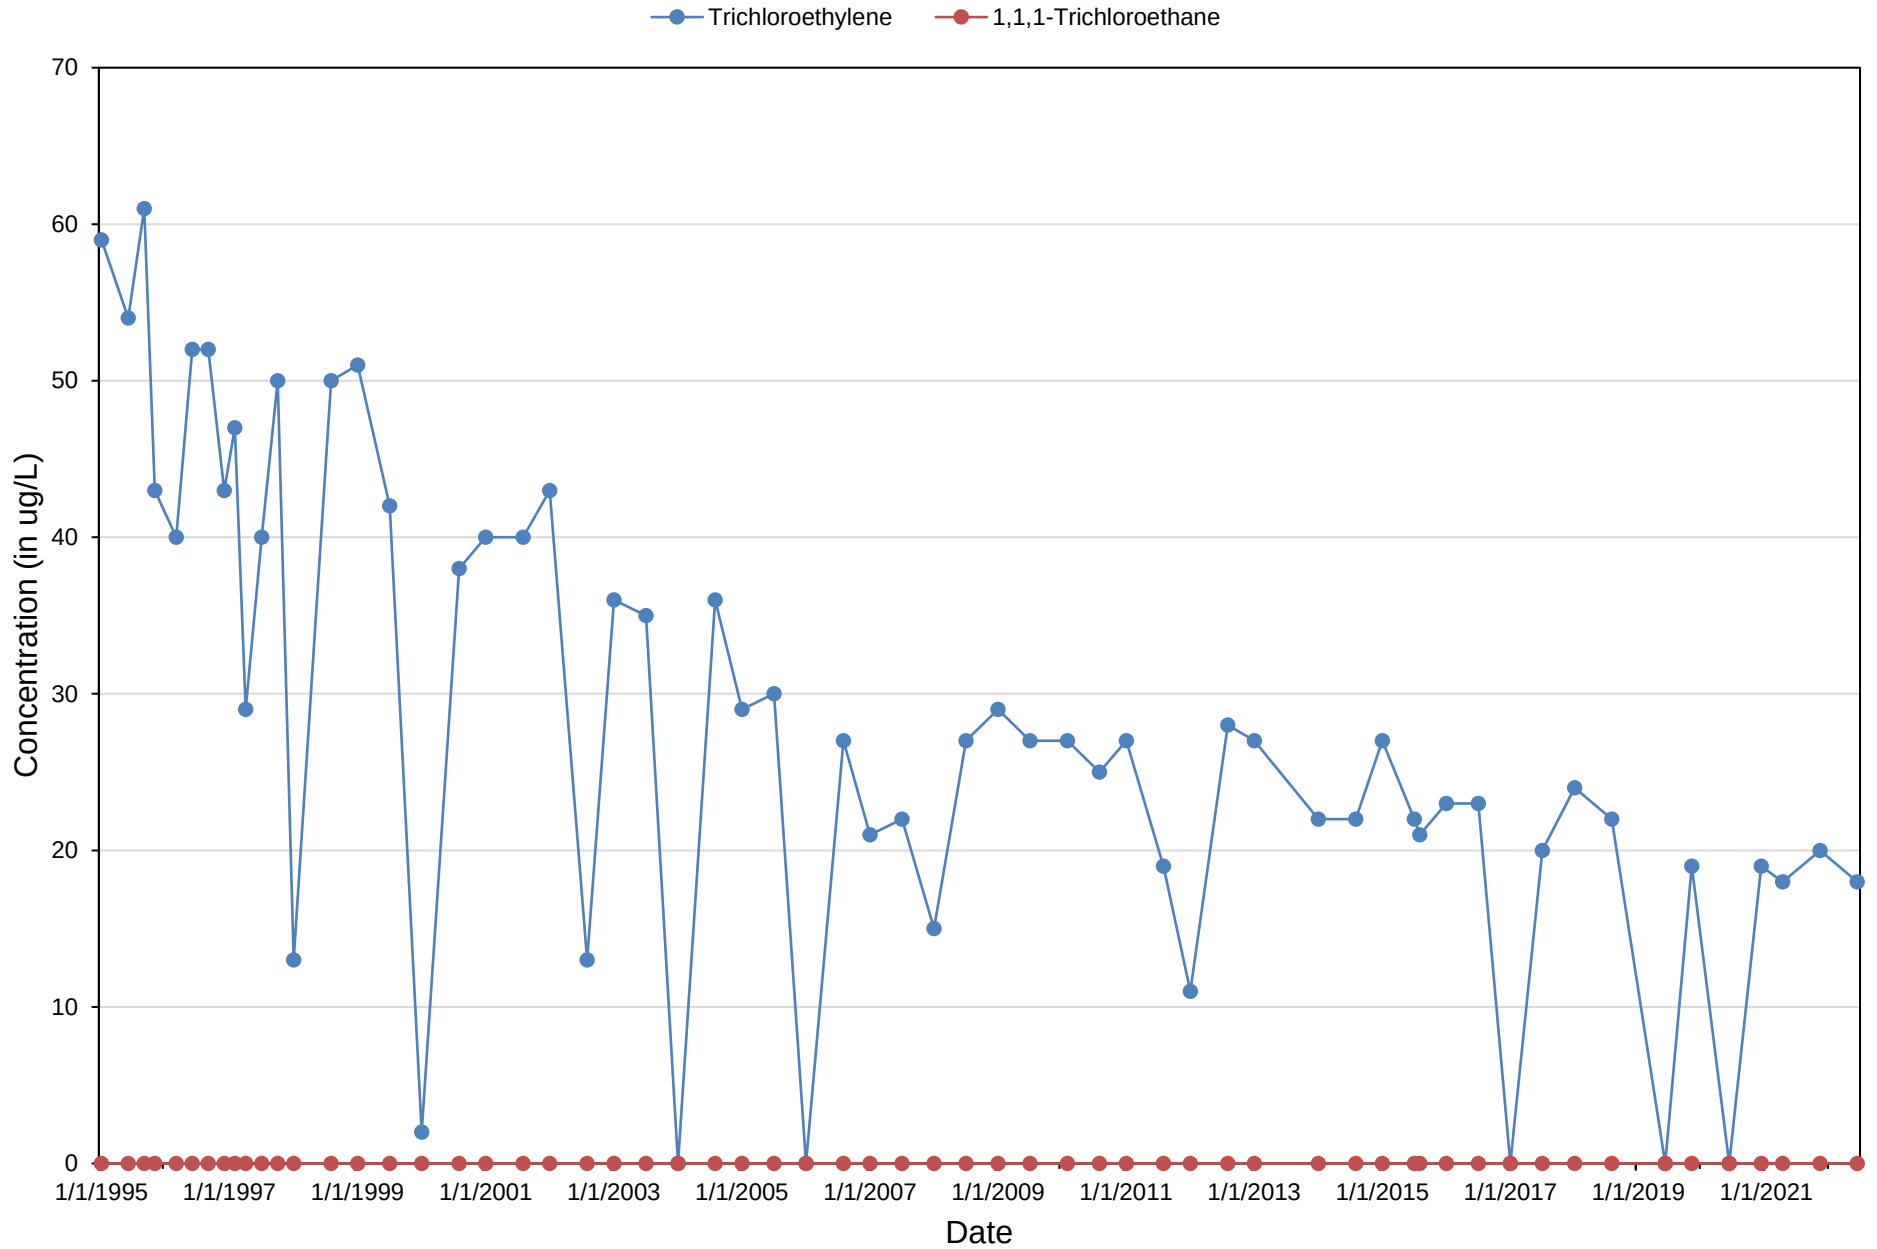


Concentration vs. Time - MW-06DA

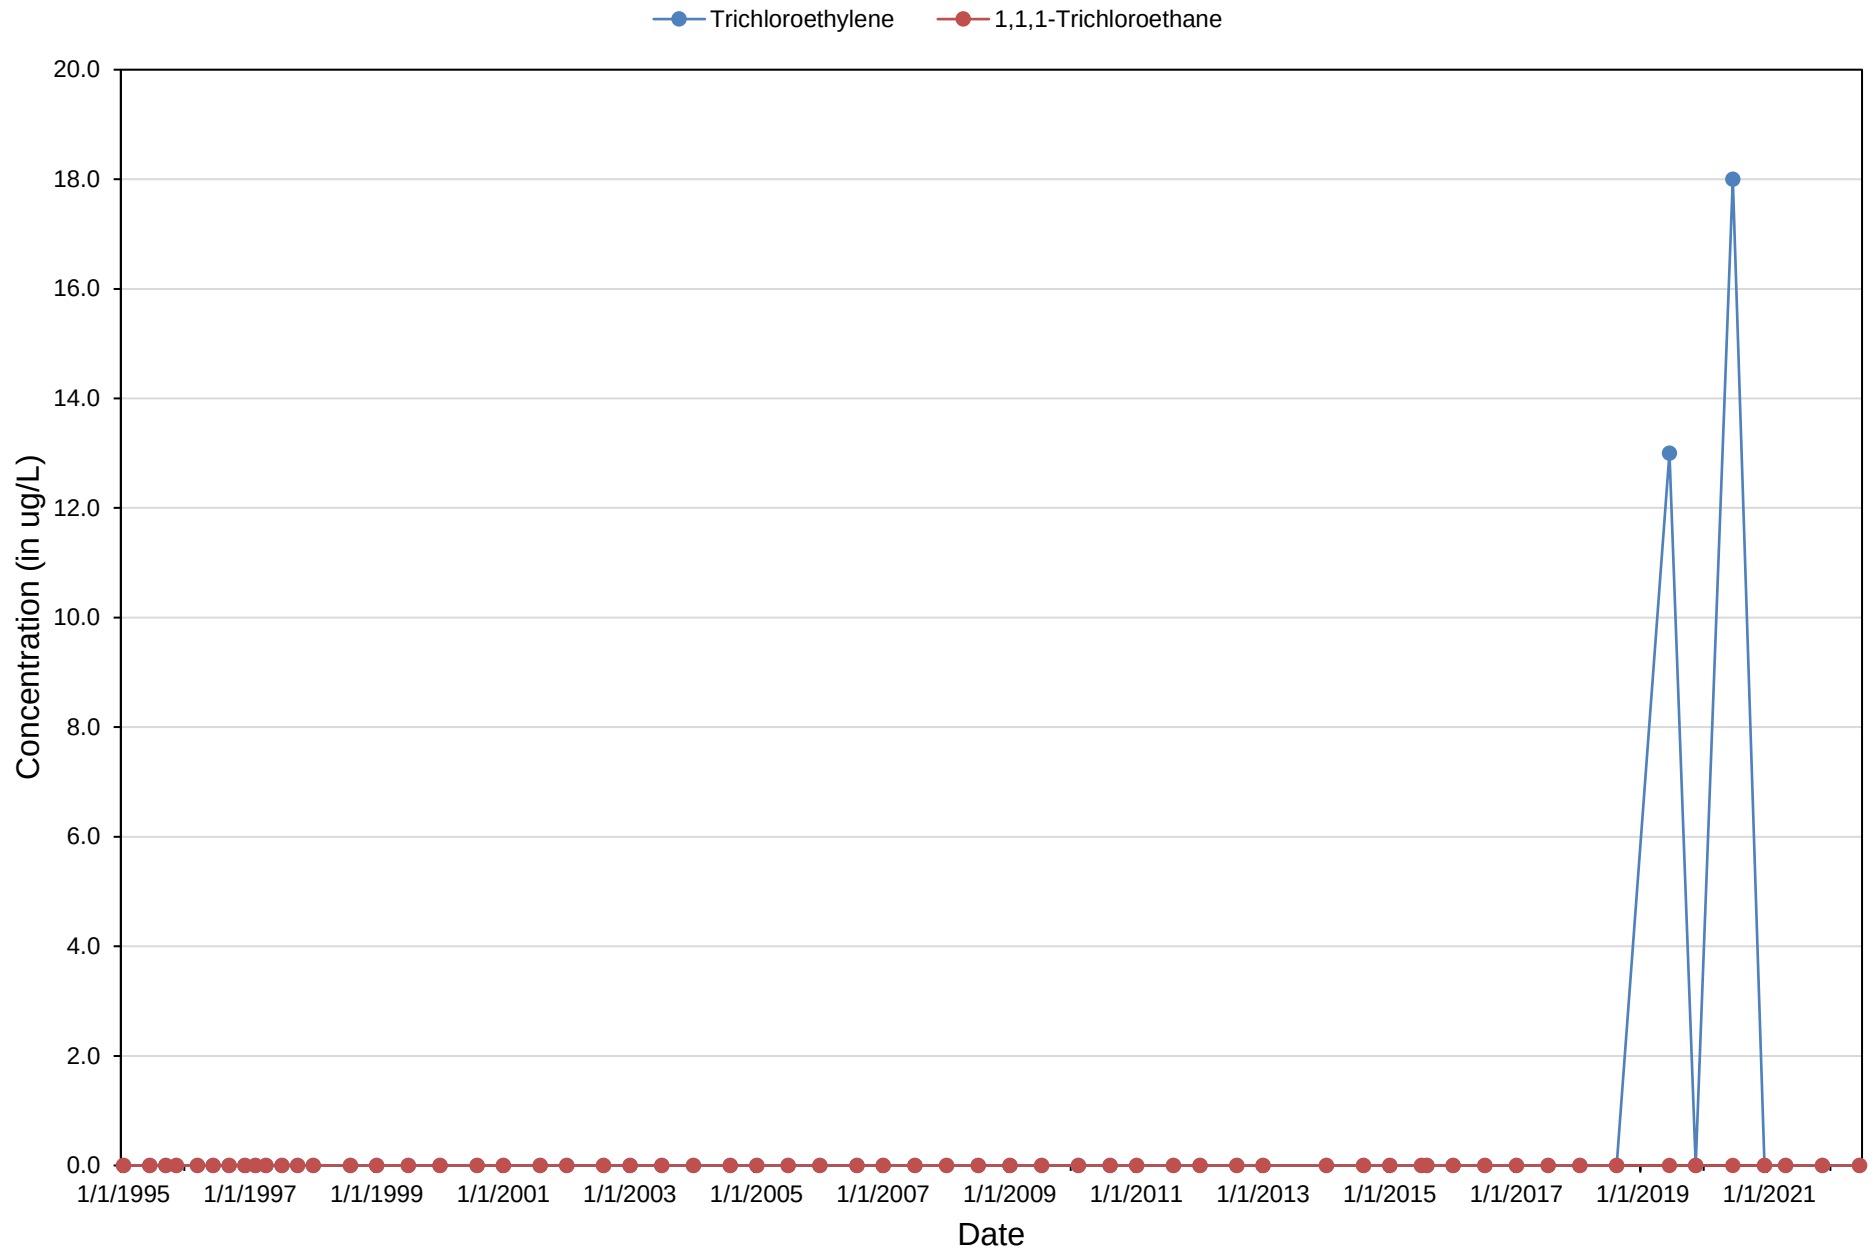


Concentration vs. Time - MW-07

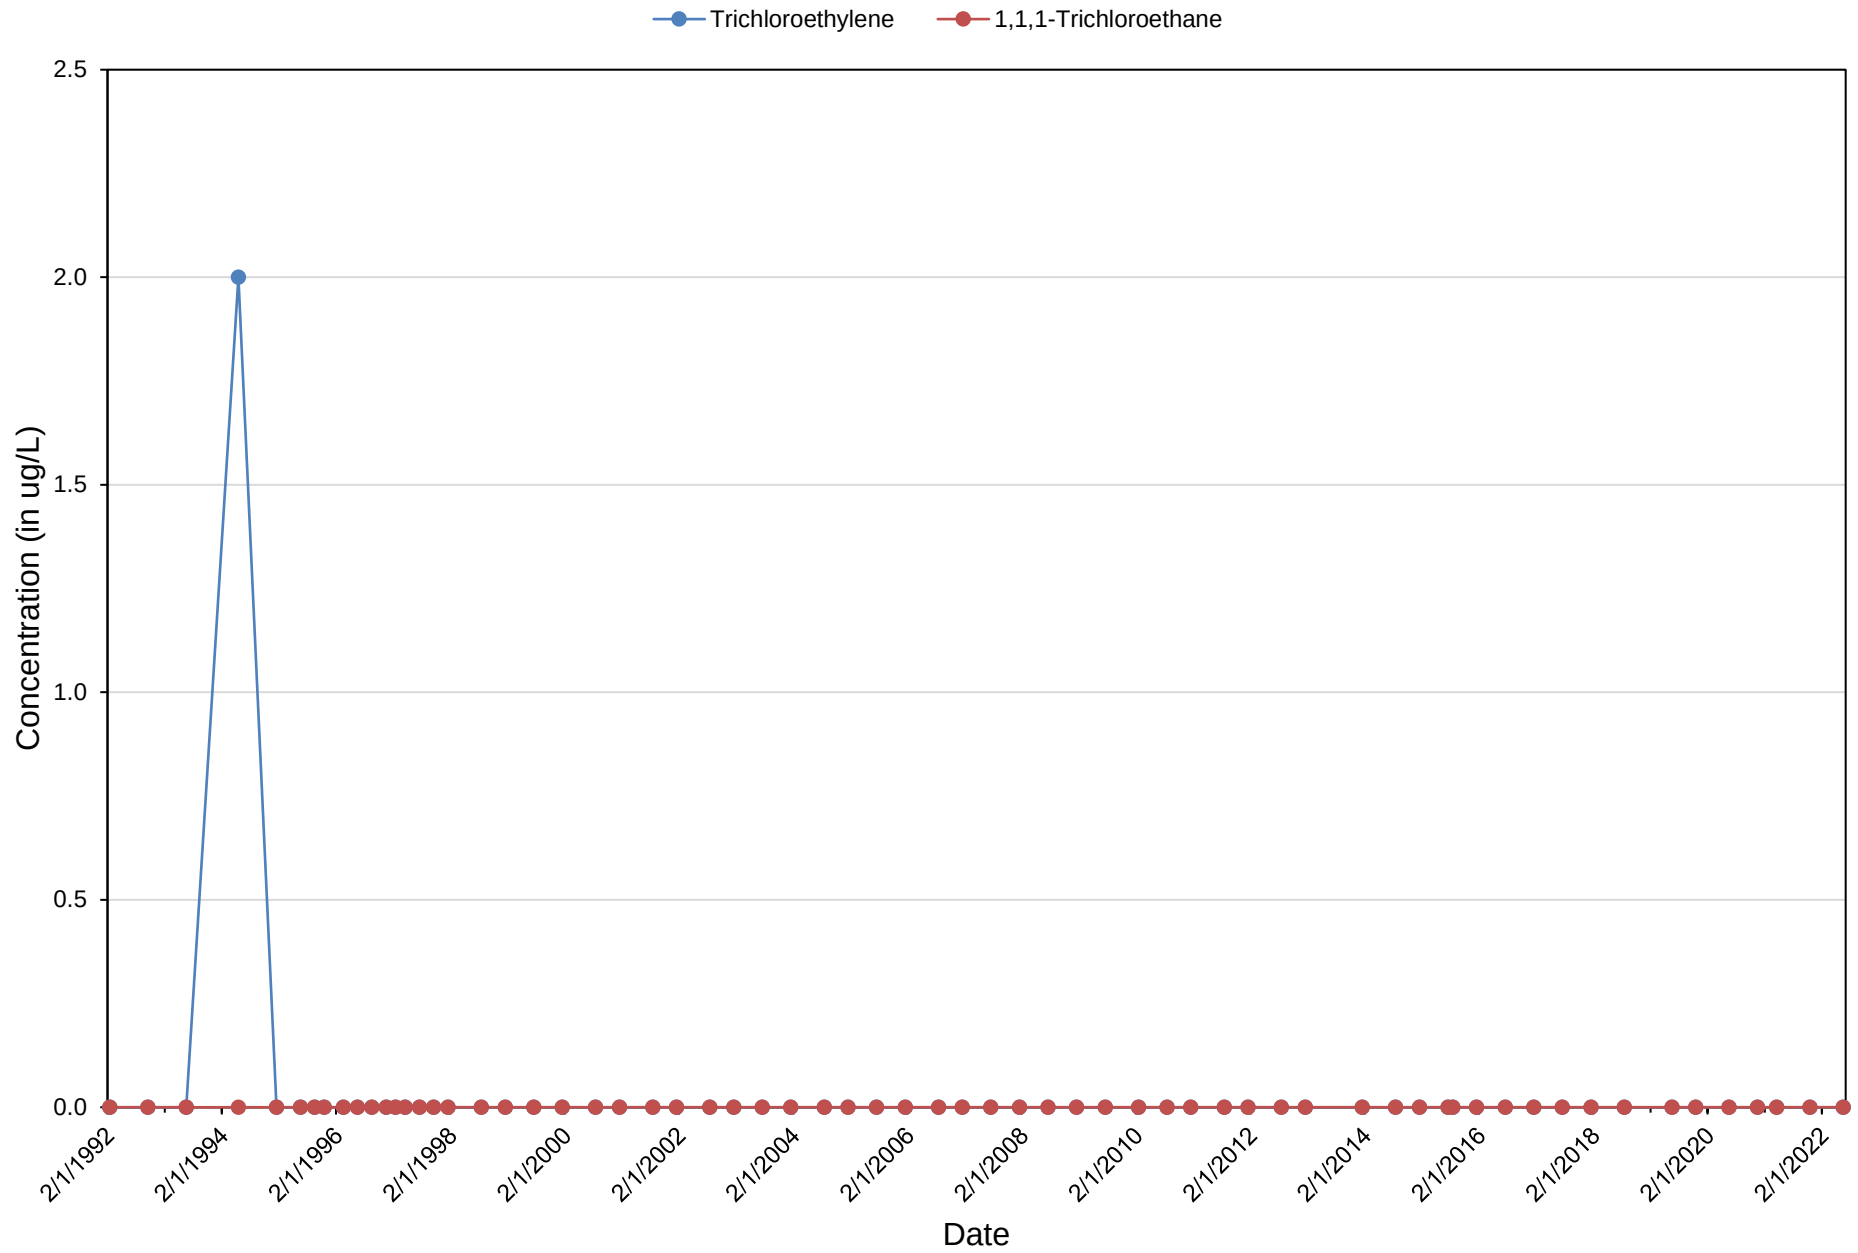


Concentration vs. Time - MW-09

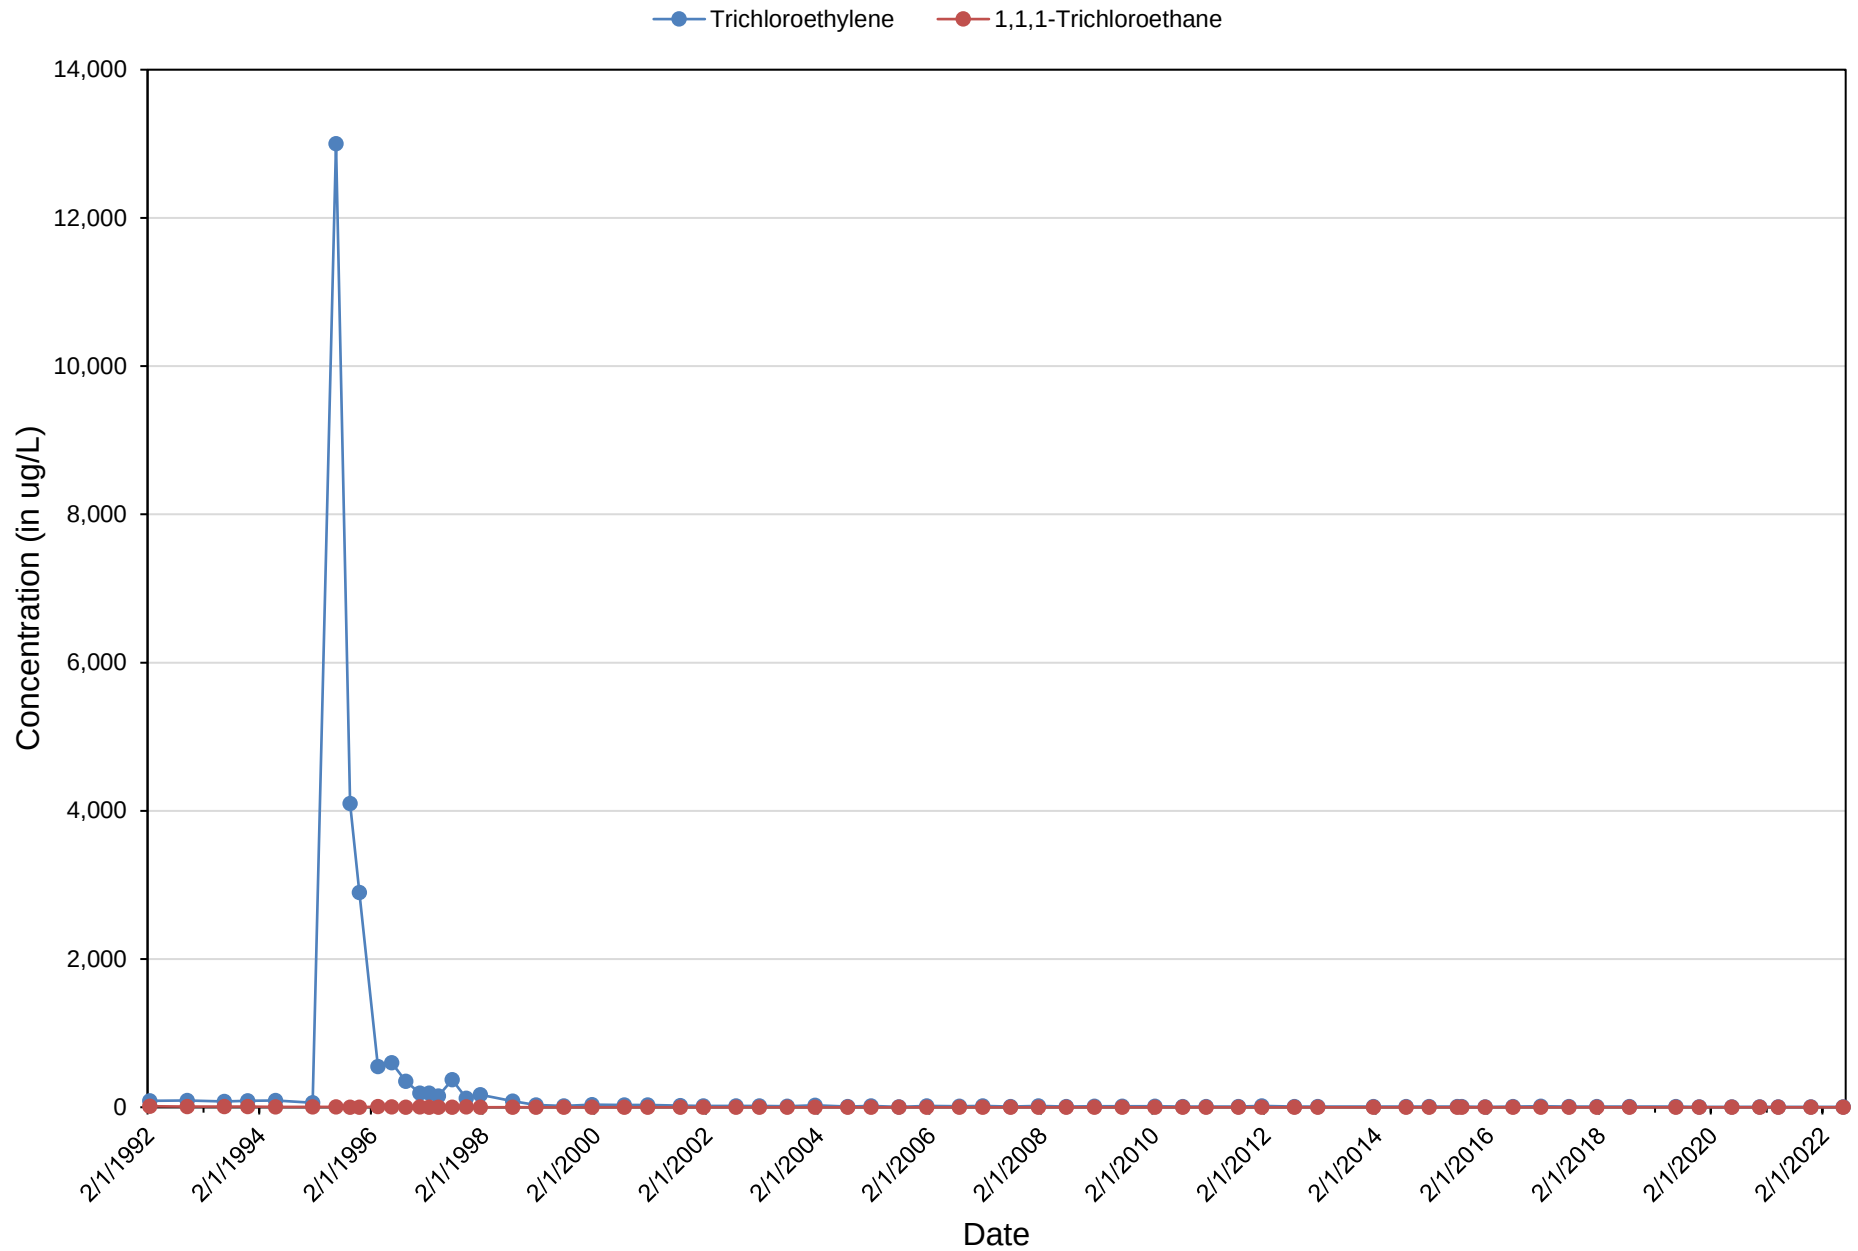


Concentration vs. Time - MW-09D

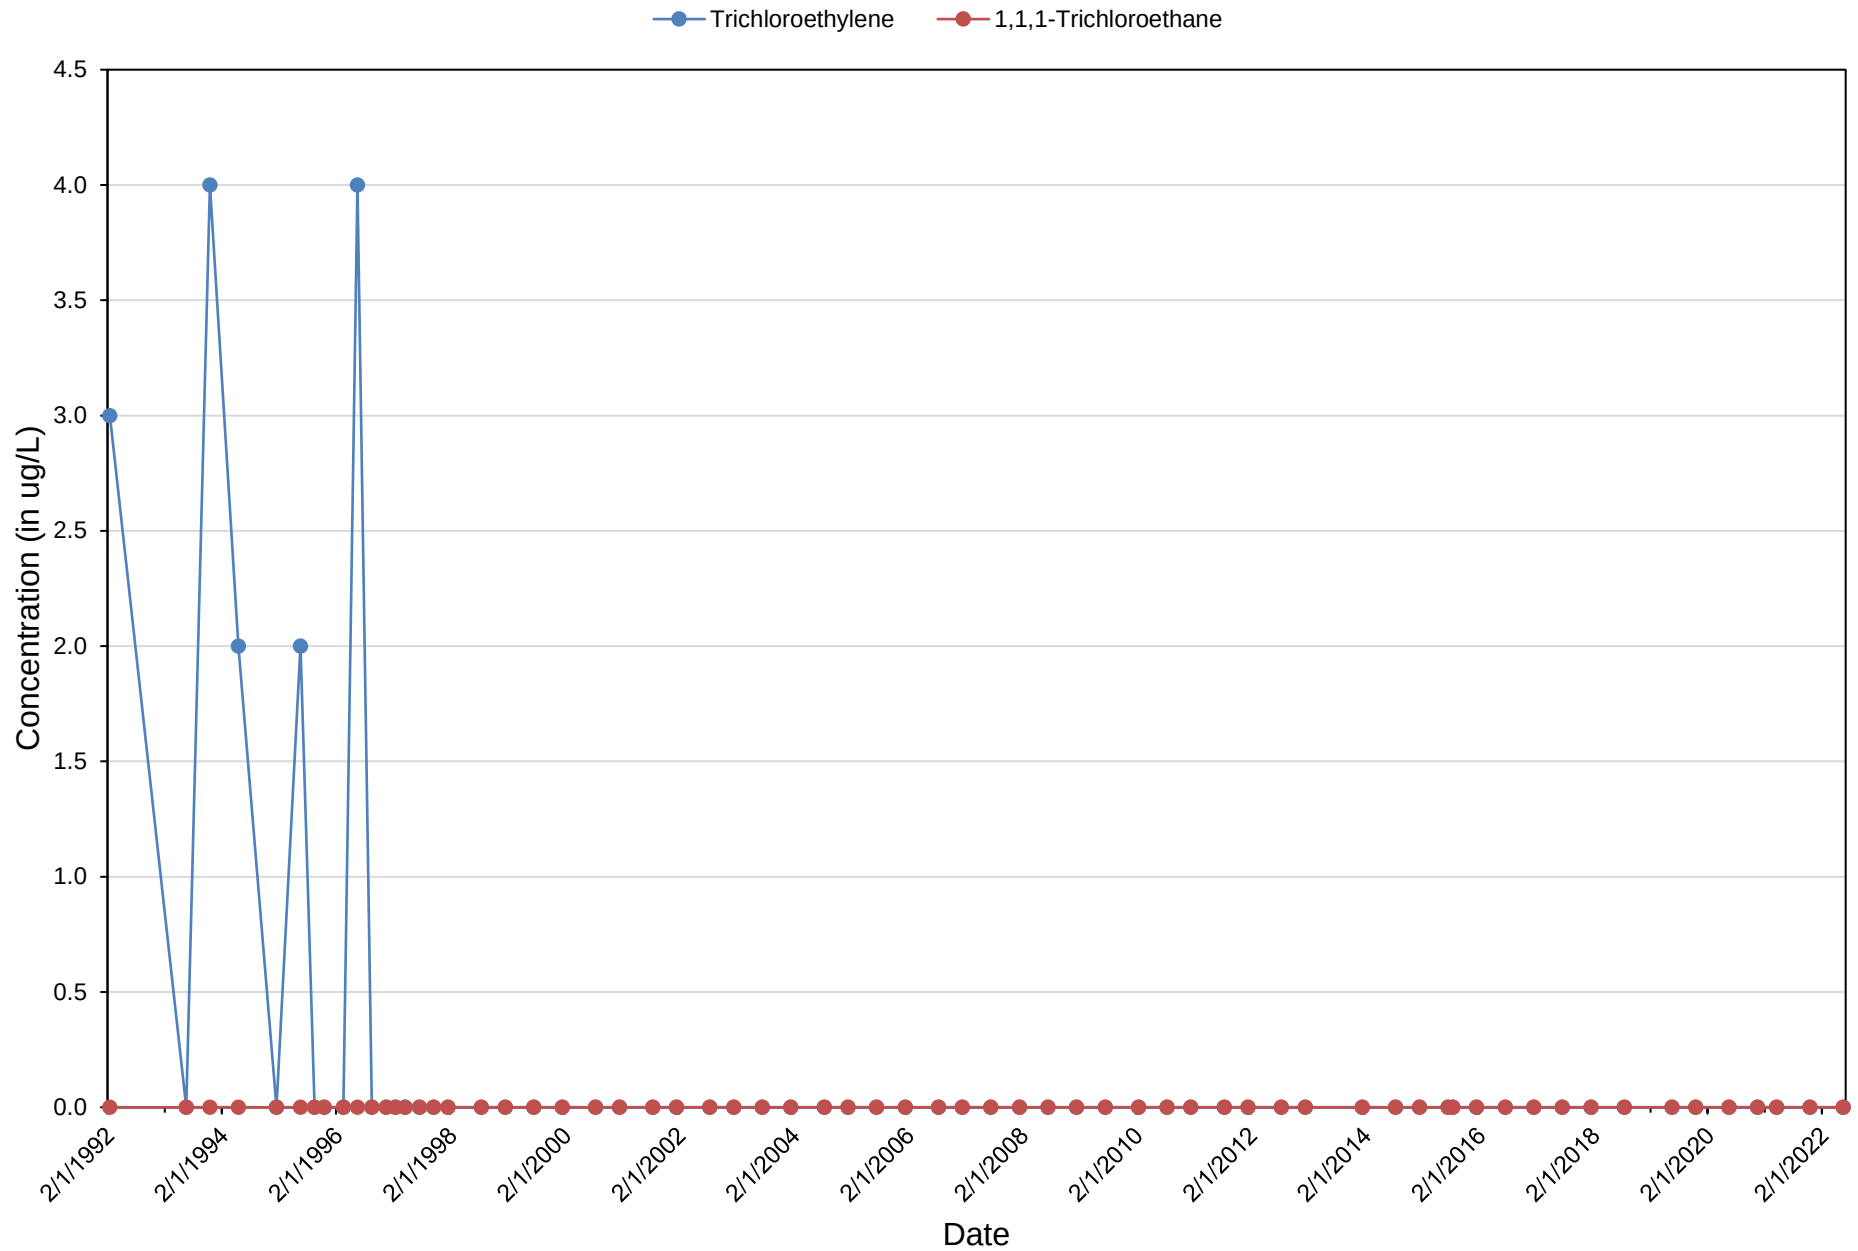


Concentration vs. Time - MW-11

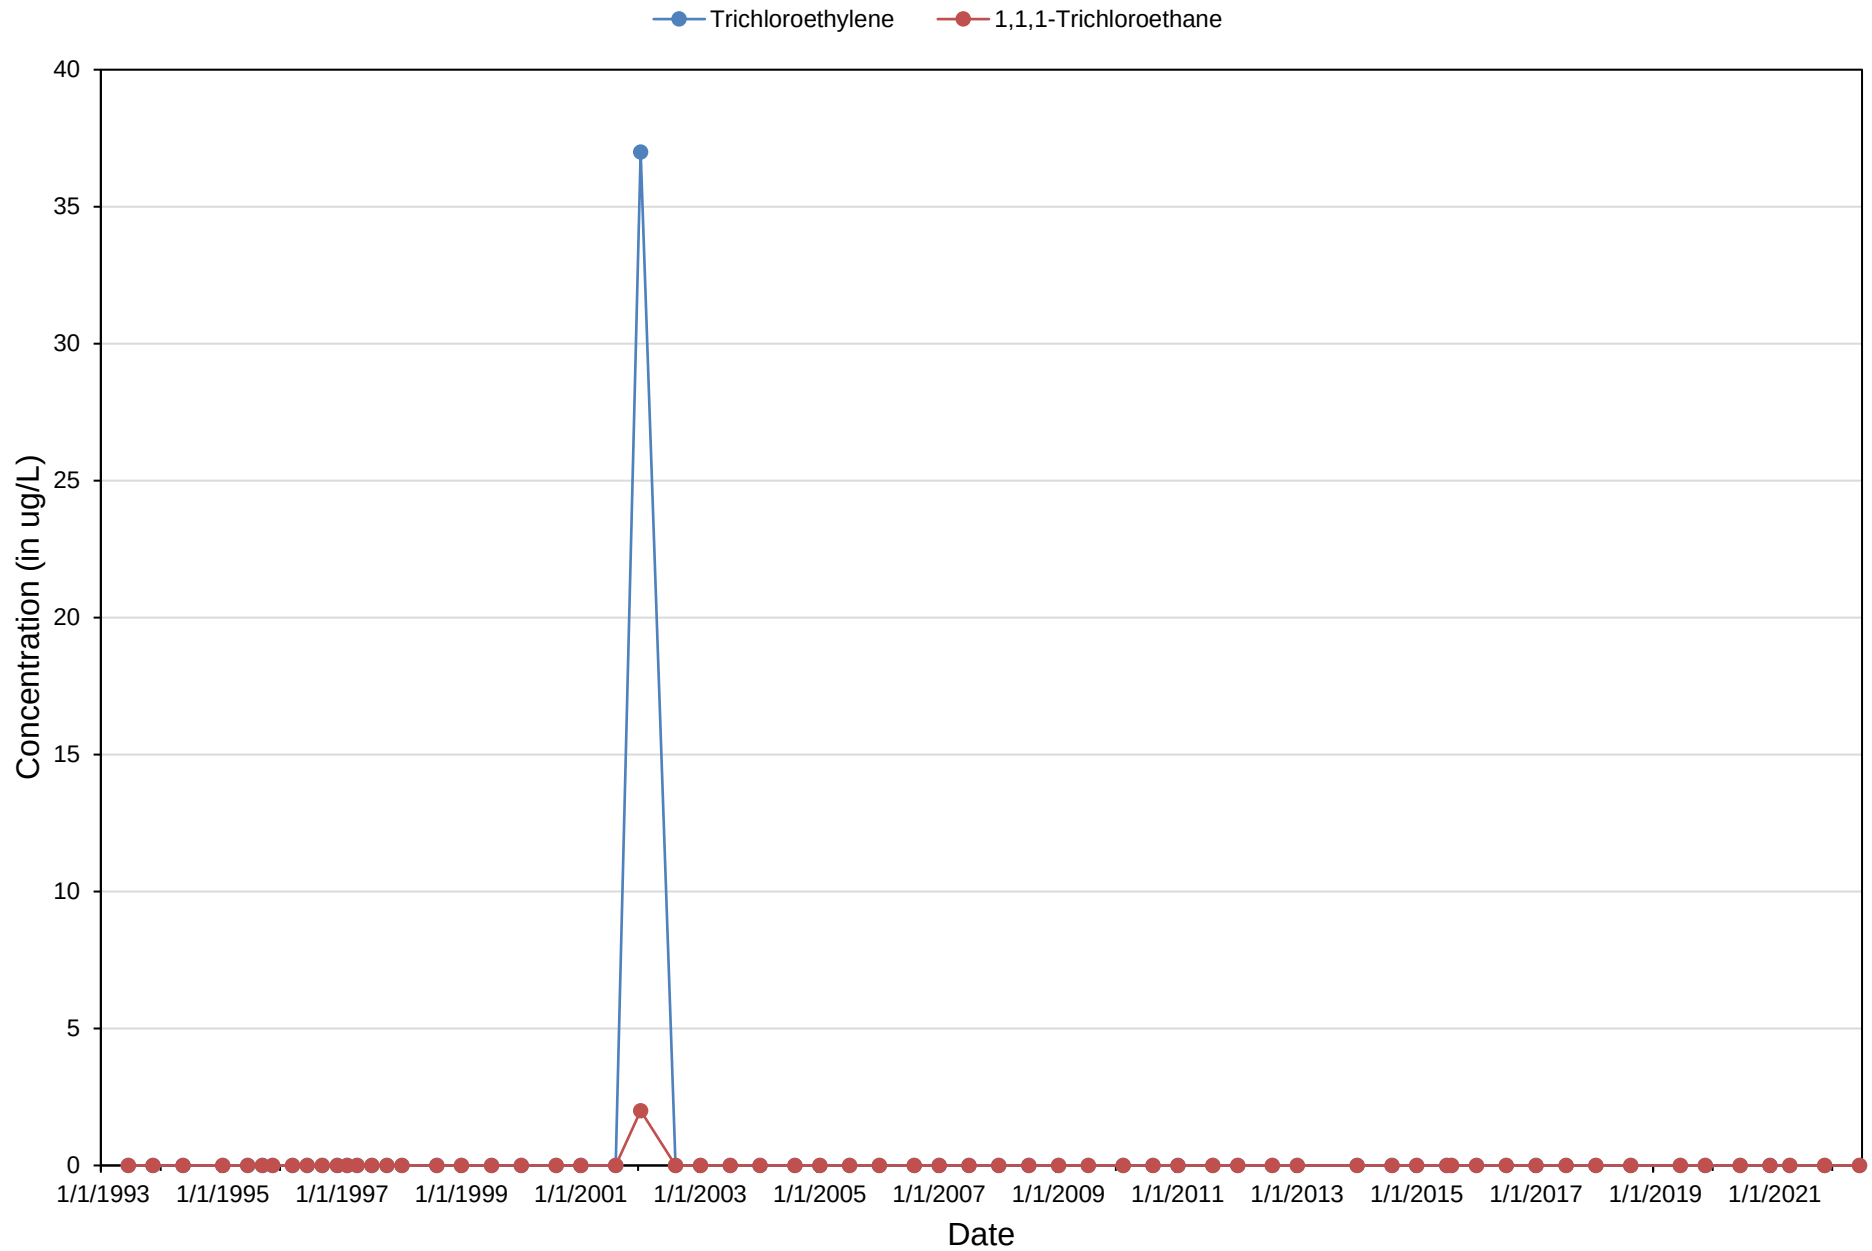

Concentration vs. Time - MW-12

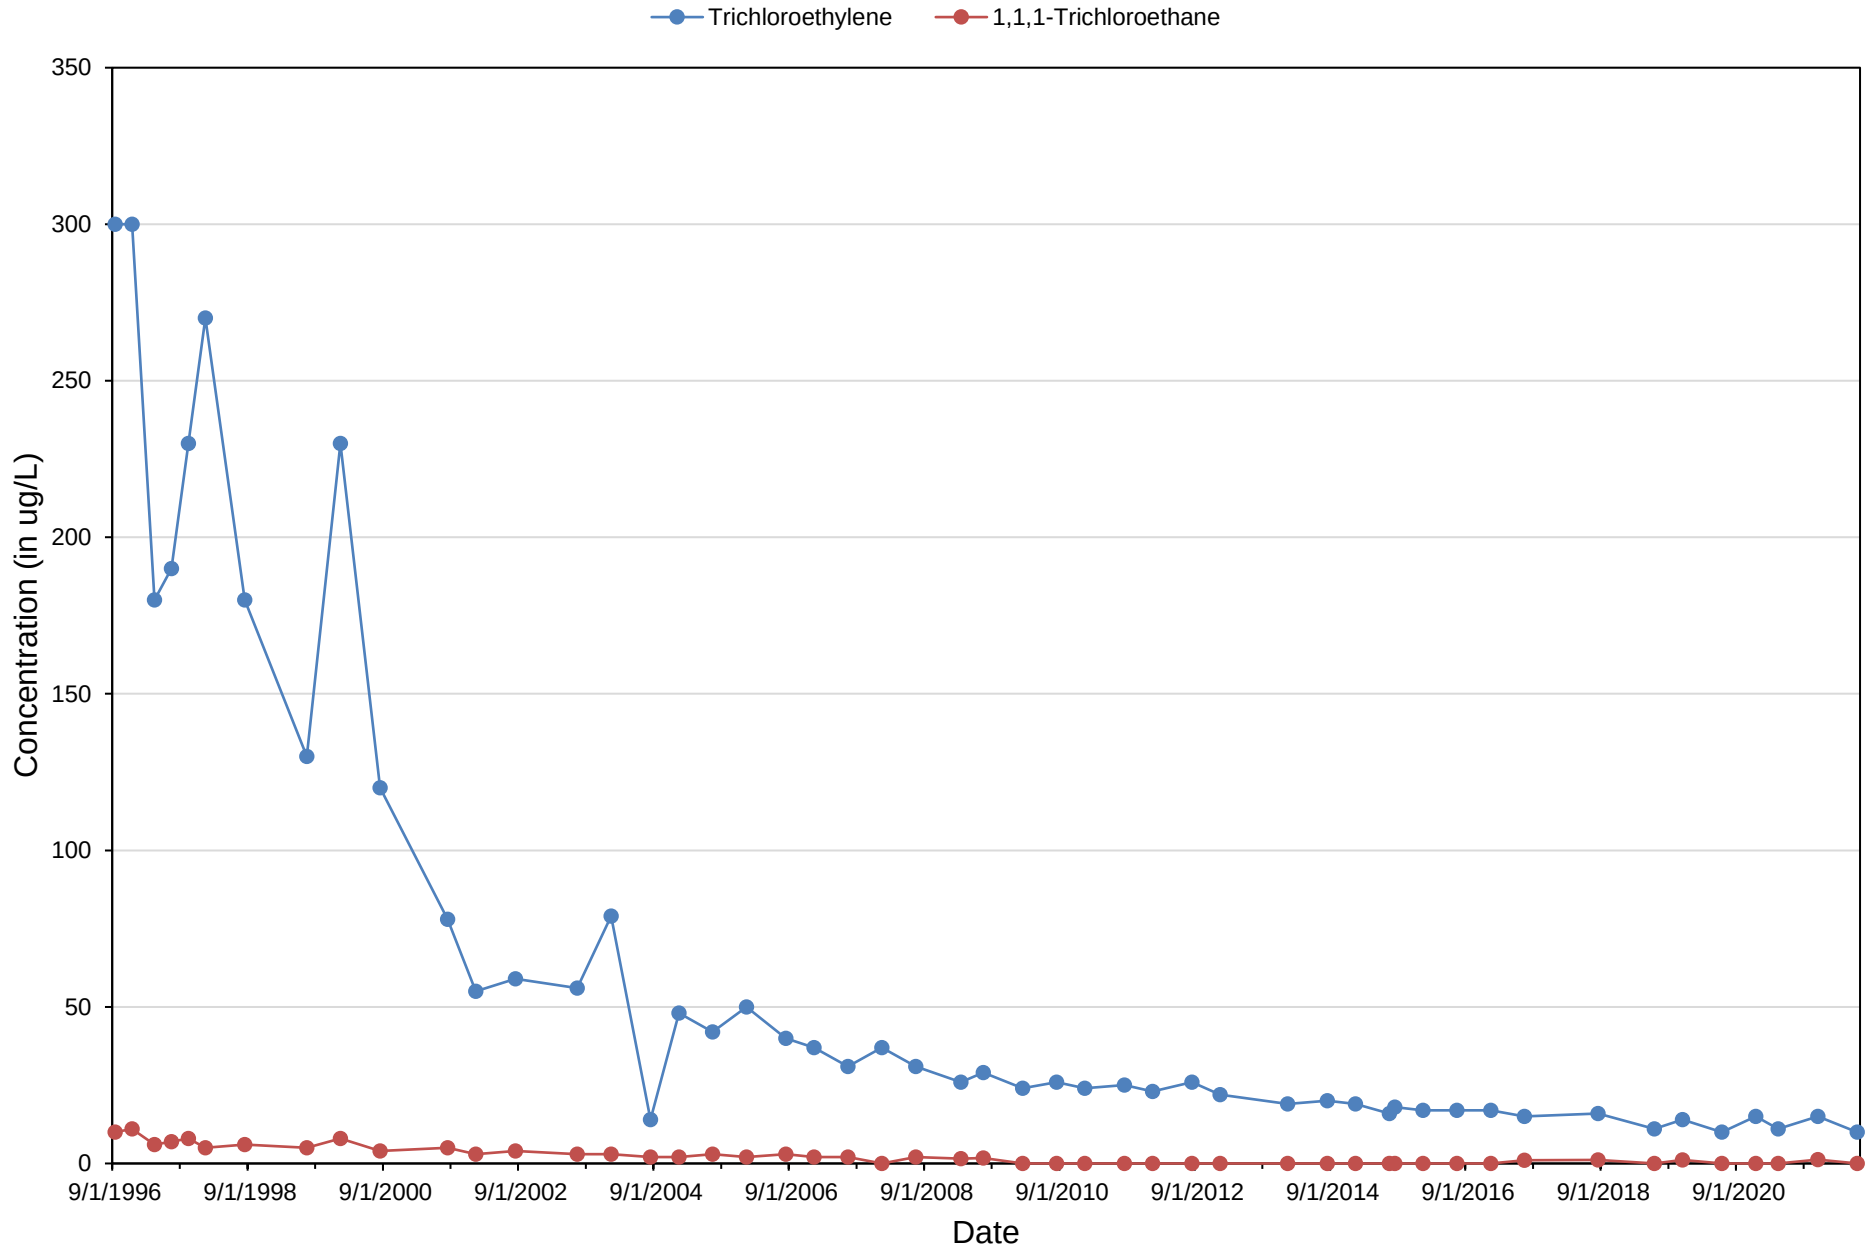


Concentration vs. Time - MW-13

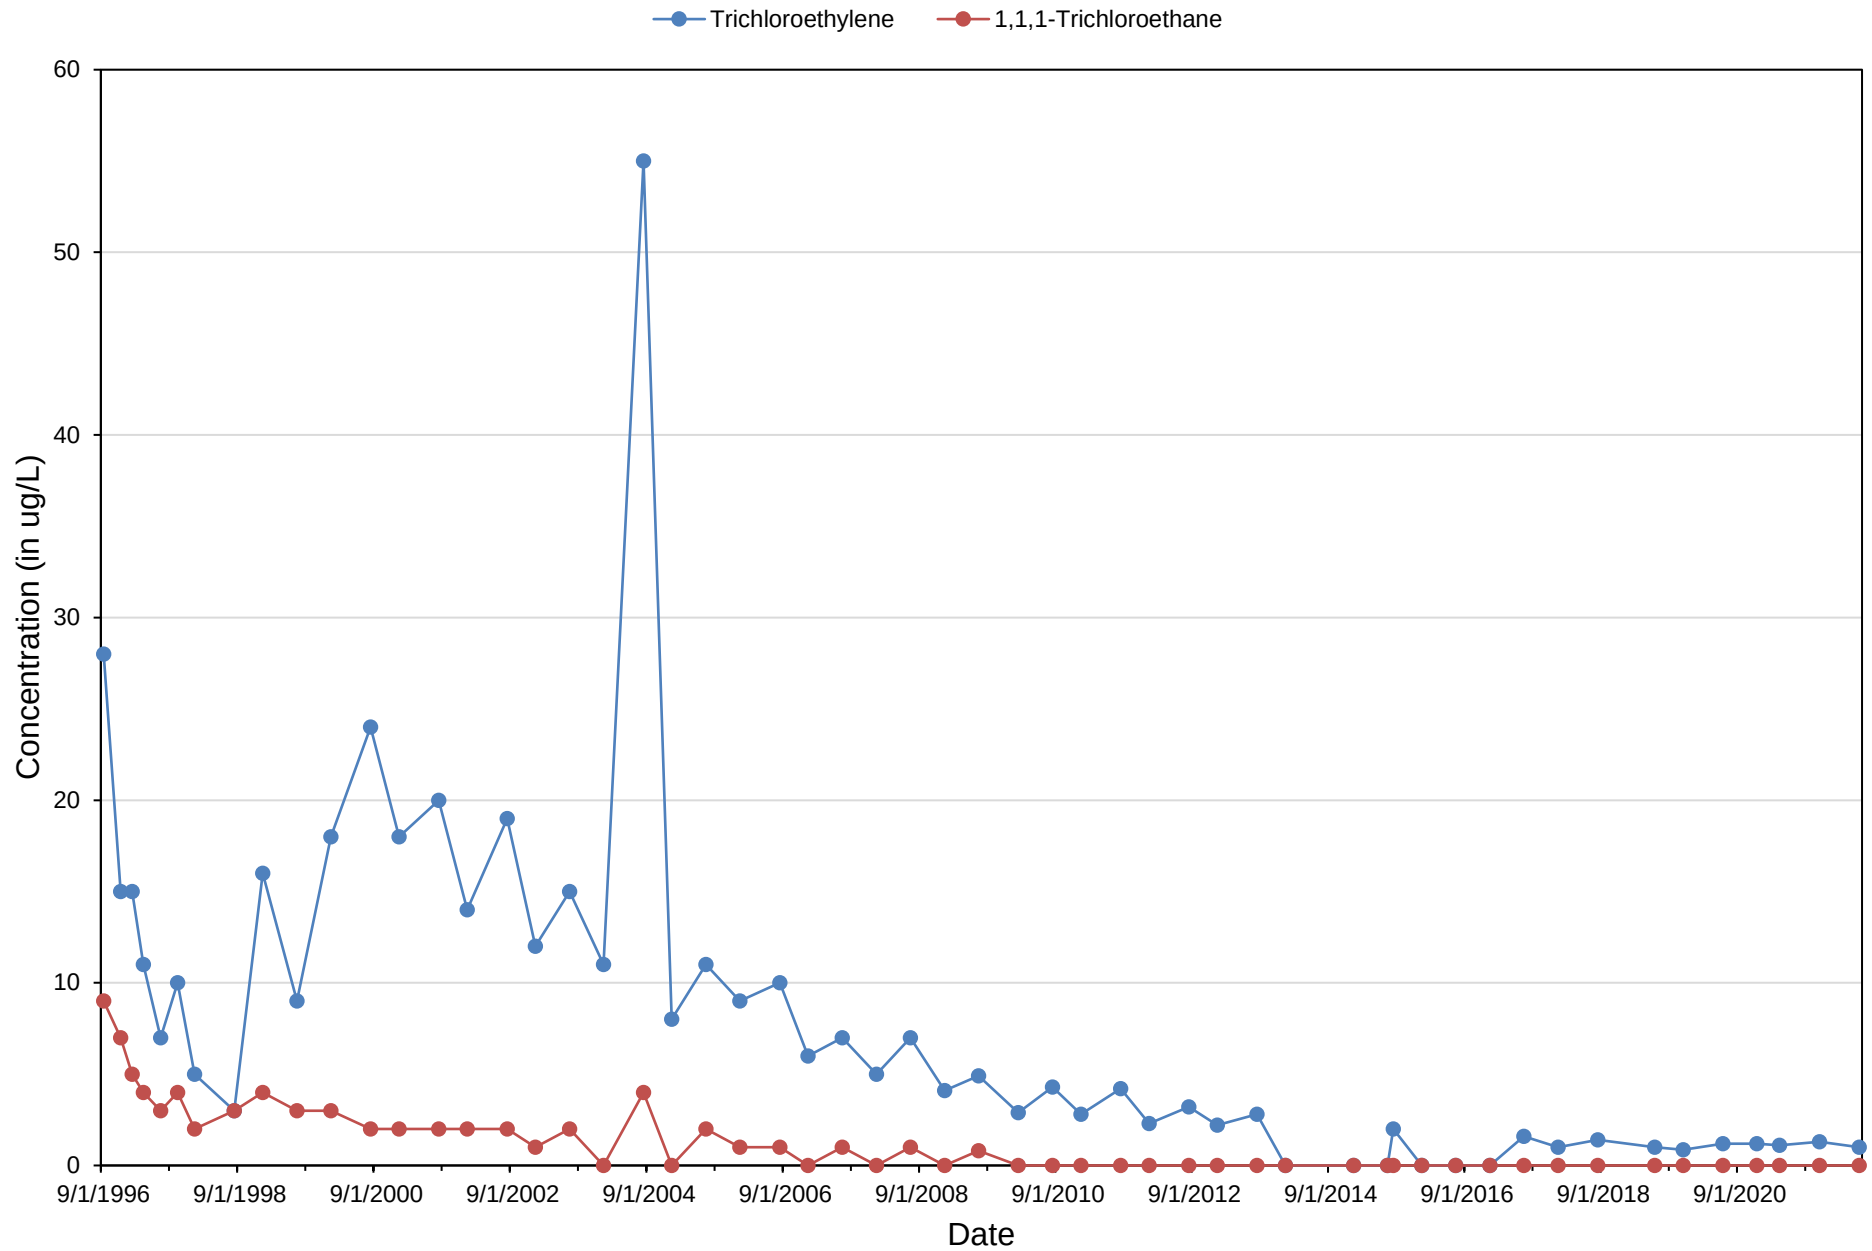

Concentration vs. Time - MW-14

Trichloroethylene 1,1,1-Trichloroethane

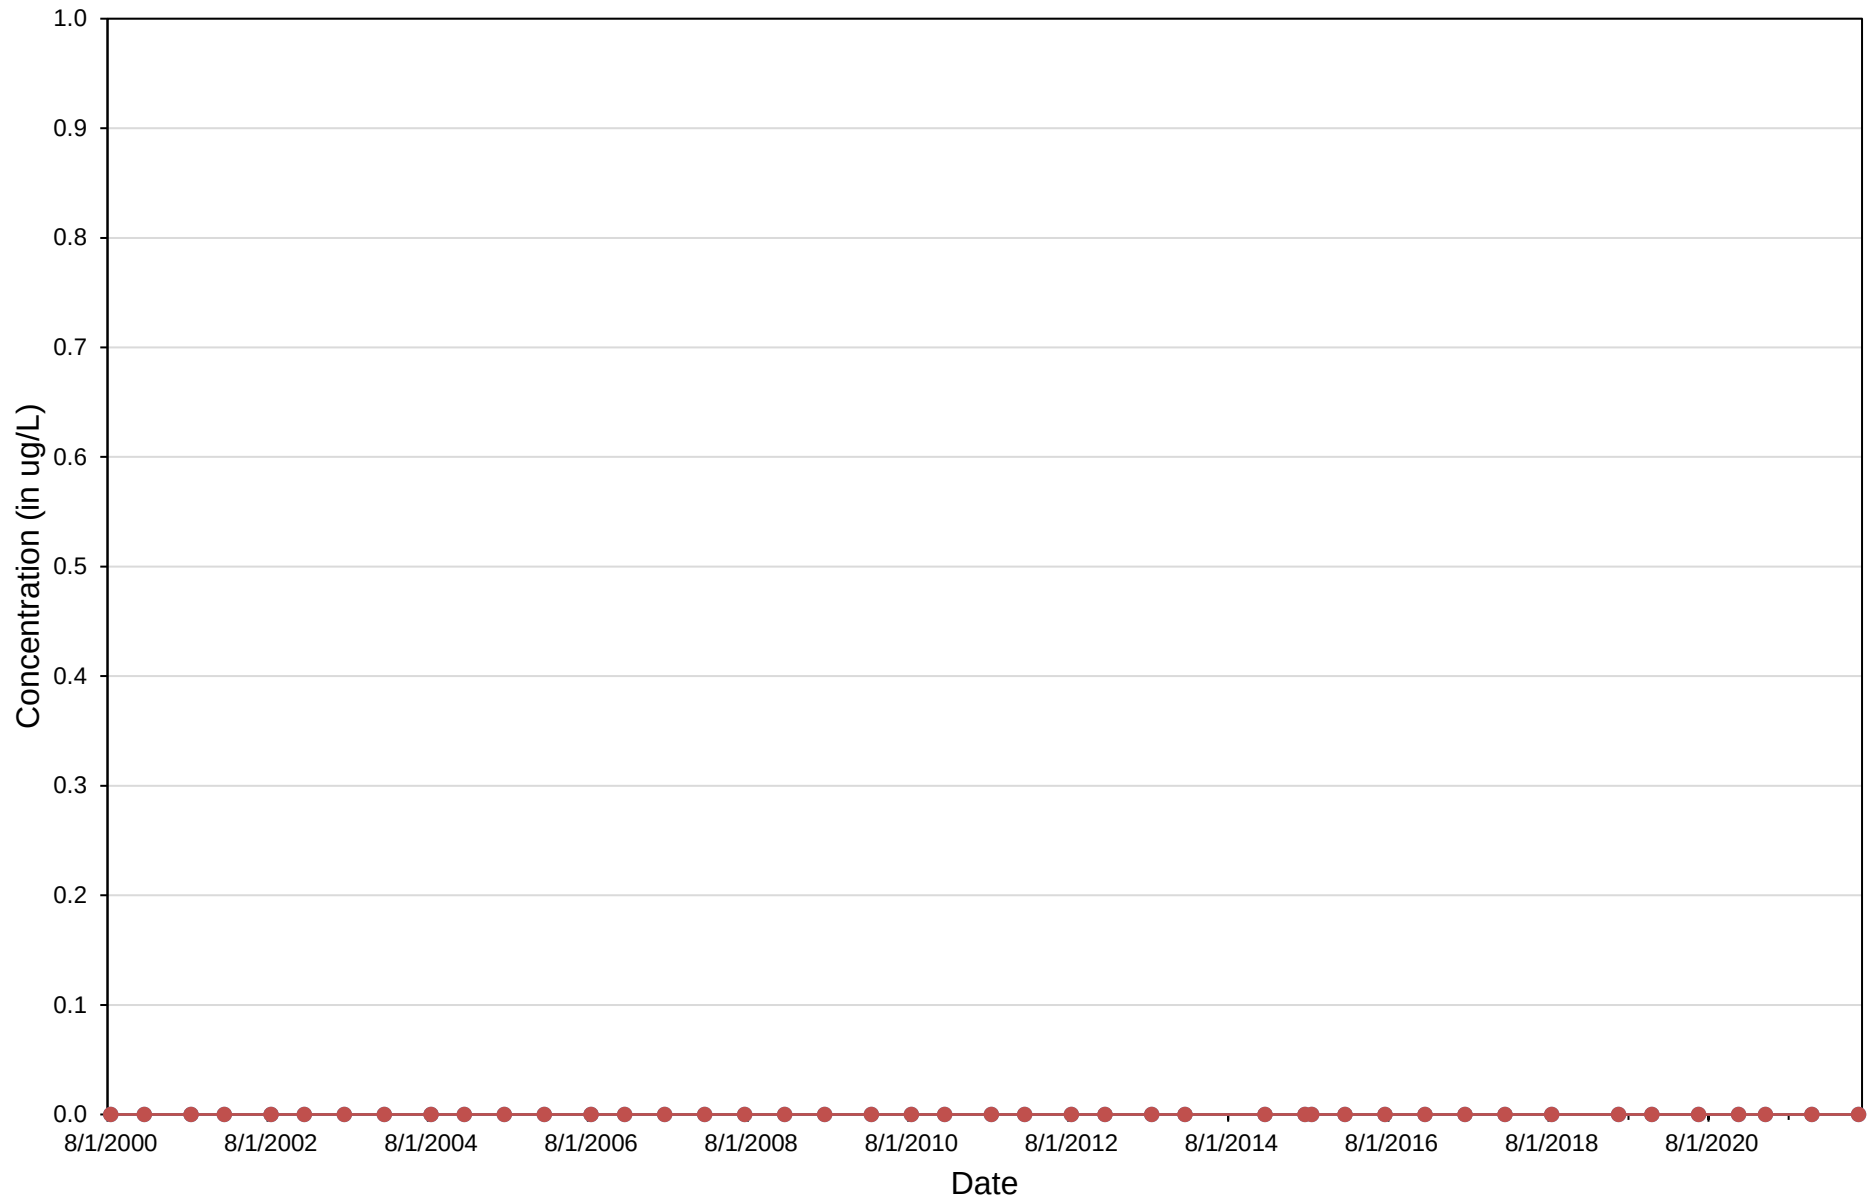

ATTACHMENT 5
IC/EC Annual Certification



Enclosure 2
NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION
Site Management Periodic Review Report Notice
Institutional and Engineering Controls Certification Form



Site No. **961009** **Site Details** **Box 1**

Site Name Prestolite Plant Site

Site Address: 400 Main Street Zip Code: 14009
City/Town: Arcade
County: Wyoming
Site Acreage: 22.000

Reporting Period: July 15, 2021 to July 15, 2022

- | | YES | NO |
|--------------------------------------|-------------------------------------|--------------------------|
| 1. Is the information above correct? | ☒ | ☐ |

If NO, include handwritten above or on a separate sheet.

- | | | |
|---|--------------------------|-------------------------------------|
| 2. Has some or all of the site property been sold, subdivided, merged, or undergone a tax map amendment during this Reporting Period? | ☐ | ☒ |
| 3. Has there been any change of use at the site during this Reporting Period (see 6NYCRR 375-1.11(d))? | ☐ | ☒ |
| 4. Have any federal, state, and/or local permits (e.g., building, discharge) been issued for or at the property during this Reporting Period? | ☐ | ☒ |

If you answered YES to questions 2 thru 4, include documentation or evidence that documentation has been previously submitted with this certification form.

- | | | |
|--|--------------------------|-------------------------------------|
| 5. Is the site currently undergoing development? | ☐ | ☒ |
|--|--------------------------|-------------------------------------|

Box 2

- | | YES | NO |
|--|-------------------------------------|--------------------------|
| 6. Is the current site use consistent with the use(s) listed below?
Commercial and Industrial | ☒ | ☐ |
| 7. Are all ICs in place and functioning as designed? | ☒ | ☐ |

**IF THE ANSWER TO EITHER QUESTION 6 OR 7 IS NO, sign and date below and
DO NOT COMPLETE THE REST OF THIS FORM. Otherwise continue.**

A Corrective Measures Work Plan must be submitted along with this form to address these issues.

Signature of Owner, Remedial Party or Designated Representative

Date

Description of Institutional ControlsParcel**183.13-2-14.1**Owner

Prestolite Electric, Inc.

Institutional ControlLanduse Restriction
Ground Water Use Restriction
Monitoring Plan

O&M Plan

Per Declaration of Covenants and Restrictions (Filed with Wyoming County Clerk on April 24, 2001):

1. The Order is binding upon Motorola and Prestolite.
2. This Declaration shall run with the Property and to the benefit of NYSDEC, and shall be binding upon all future owners of the portions of the Property affected by this Declaration, and upon each and every tenant, subtenant, invitee and licensee of thereof, and cannot be modified without the consent of the NYSDEC (or any New York State Department, Bureau or other entity replacing NYSDEC).
3. The Property, having been listed by NYSDEC as a Class 3 Site in the Registry of Inactive Hazardous Waste Disposal Sites in New York State, is subject to applicable restrictions on the use of the Property, including those specified by § 375-1.2(c) of the Environmental Conservation regulations embodied in Title 6 of the New York Code of Rules and Regulations. Use of the Property is thereby limited such that no person may engage in any activity:
 - (a) that will, or that is reasonably anticipated to, prevent to interfere significantly with any proposed, ongoing or completed remedial program affecting the Property, including any activity that will intrude into waste materials or will otherwise diminish the effectiveness of the remedy, or
 - (b) that will, or is reasonably likely to, expose the public health or the environment to a significantly increased threat of harm or damage to the Property.In addition, (i) there shall be no wells drilled into any groundwater aquifer(s) beneath the Property and (ii) with respect to the portion of the Property lying southwest of the railroad tracks which includes the "wastewater treatment plant" and the "former chemical storage building" (as depicted on the Site Plan attached hereto as Exhibit "B") there shall be no construction of new buildings, and any utility work shall be done in accordance with health and safety plans approved by NYSDEC. Except in emergency situations as determined by the applicable utility company, NYSDEC shall be provided with reasonable prior notice of any proposed utility work in these affected portions of the Property.
4. Use of the Property may be further restricted by applicable law and/or by other orders issued or to be issued according to applicable law.
5. Any deed of conveyance of the Property is subject to and encumbered by this Declaration.

In addition to the above-cited controls required under the Declaration of Covenants and Restrictions, operation and maintenance of the Site's Soil Vapor Mitigation System is required.

Description of Engineering ControlsParcel**183.13-2-14.1**Engineering ControlVapor Mitigation
Cover System
Monitoring Wells

Periodic Review Report (PRR) Certification Statements

1. I certify by checking "YES" below that:

- a) the Periodic Review report and all attachments were prepared under the direction of, and reviewed by, the party making the Engineering Control certification;
- b) to the best of my knowledge and belief, the work and conclusions described in this certification are in accordance with the requirements of the site remedial program, and generally accepted engineering practices; and the information presented is accurate and complete.

YES NO



2. For each Engineering control listed in Box 4, I certify by checking "YES" below that all of the following statements are true:

- (a) The Engineering Control(s) employed at this site is unchanged since the date that the Control was put in-place, or was last approved by the Department;
- (b) nothing has occurred that would impair the ability of such Control, to protect public health and the environment;
- (c) access to the site will continue to be provided to the Department, to evaluate the remedy, including access to evaluate the continued maintenance of this Control;
- (d) nothing has occurred that would constitute a violation or failure to comply with the Site Management Plan for this Control; and
- (e) if a financial assurance mechanism is required by the oversight document for the site, the mechanism remains valid and sufficient for its intended purpose established in the document.

YES NO



**IF THE ANSWER TO QUESTION 2 IS NO, sign and date below and
DO NOT COMPLETE THE REST OF THIS FORM. Otherwise continue.**

A Corrective Measures Work Plan must be submitted along with this form to address these issues.

Signature of Owner, Remedial Party or Designated Representative

Date

IC CERTIFICATIONS
SITE NO. 961009

Box 6

SITE OWNER OR DESIGNATED REPRESENTATIVE SIGNATURE

I certify that all information and statements in Boxes 1,2, and 3 are true. I understand that a false statement made herein is punishable as a Class "A" misdemeanor, pursuant to Section 210.45 of the Penal Law.

I John Pekala at Motorola Solutions, Inc.
print name 3332 E. Broadway Rd, Phoenix, AZ 85040
print business address

am certifying as Remedial Party (Owner or Remedial Party)

for the Site named in the Site Details Section of this form.

[Signature]
Signature of Owner, Remedial Party, or Designated Representative
Rendering Certification

8/2/2022
Date

EC CERTIFICATIONS


Box 7

Qualified Environmental Professional Signature

I certify that all information in Boxes 4 and 5 are true. I understand that a false statement made herein is punishable as a Class "A" misdemeanor, pursuant to Section 210.45 of the Penal Law.

I Patrick Allenstein at KPRG and Associates, Inc.
14665 W. Lisbon Rd., Suite 1A
Brookfield, WI 53005
print name print business address

am certifying as a Qualified Environmental Professional for the Motorola Solutions, Inc.
(Owner or Remedial Party)



Signature of Qualified Environmental Professional, for
the Owner or Remedial Party, Rendering Certification

Stamp
(Required for PE)

8/3/22

Date

ATTACHMENT 6
**Cemetery Creek, Soil Cover, Drainage Swale,
and Sub-Slab Depressurization System Inspection Reports**

Soil Erosion Prevention Site Inspection Form
(Waste Water Treatment Facility and Former Chemical Storage Building Area)

Inspector:

Name

Date

Jim Rodurton²
12/17/2021

Type of Inspection:

quarterly

semi-annual

annual

severe weather

	Observation			Comments
	Good	Fair	Poor	
1. Vegetative cover (condition, trees or bushes on cap)	<i>X</i>			
2. Soil stability (erosion control)	<i>X</i>			
3. Cover integrity (no exposed stabilized soil or ruts)	<i>X</i>			
4. Surface water drainage (settlement or ponding)	<i>X</i>			
5. Unauthorized access control (fence, gates, locks, signs vandalism)	<i>X</i>			
6. Other activities on or adjacent to soil erosion prevention area	<i>X</i>			
7. Upgradient Storm Water Swale (condition, encroachment of brush, erosion, etc.)	<i>X</i>			

8. Additional Comments:

None

9. Items to be observed in future inspections:

None

10. Recommended maintenance activities:

None

Cemetery Creek Inspection Form

Inspector:

Name

Date

Jim Gustafson
12-17-2021

Type of Inspection:

quarterly

semi-annual

annual

severe weather

Item	Observation			Comments
1. Qualitative Stream Flow Estimate	Trickle <u>3/4 channel</u>	1/4 channel full channel (highlight one)	1/2 channel flood	
2. Condition of Channel Banks (Evidence of erosion)	<u>Good</u>	Fair (highlight one)	Poor	
3. Debris/Flow Blockage (any debris or fallen trees, etc.)	Present (highlight one)		<u>Not Present</u>	
4. Evidence of Scouring (Channel bottom erosion)	Yes (highlight one)		<u>No</u>	
5. Evidence of Sedimentation (Channel bottom filling)	Yes (highlight one)		<u>No</u>	

6. Additional Comments:

None

7. Items to be observed in future inspections:

None

8. Recommended maintenance activities:

None

Soil Erosion Prevention Site Inspection Form
(Waste Water Treatment Facility and Former Chemical Storage Building Area)

Inspector:

Name

Date

Jim Buchanan
June 9, 2022

Type of Inspection:

quarterly

semi-annual

annual

severe weather

	Observation			Comments
	Good	Fair	Poor	
1. Vegetative cover (condition, trees or bushes on cap)	X			
2. Soil stability (erosion control)	X			
3. Cover integrity (no exposed stabilized soil or ruts)	X			
4. Surface water drainage (settlement or ponding)	X			
5. Unauthorized access control (fence, gates, locks, signs vandalism)	X			
6. Other activities on or adjacent to soil erosion prevention area	X			
7. Upgradient Storm Water Swale (condition, encroachment of brush, erosion, etc.	X			

8. Additional Comments:

None at this time!

9. Items to be observed in future inspections:

None at this time!

10. Recommended maintenance activities:

None at this time!

Cemetery Creek Inspection Form

Inspector:

Name

Date

Jim Bodenstein
June 9, 2022

Type of Inspection:

quarterly

semi-annual

annual

severe weather

Item	Observation			Comments
1. Qualitative Stream Flow Estimate	Trickle 3/4 channel	<u>1/4 channel</u> full channel (highlight one)	1/2 channel flood	
2. Condition of Channel Banks (Evidence of erosion)	<u>Good</u>	Fair (highlight one)	Poor	
3. Debris/Flow Blockage (any debris or fallen trees, etc.)	Present (highlight one)		<u>Not Present</u>	
4. Evidence of Scouring (Channel bottom erosion)	Yes (highlight one)		<u>No</u>	
5. Evidence of Sedimentation (Channel bottom filling)	Yes (highlight one)		<u>No</u>	

6. Additional Comments:

None AT This Time!

7. Items to be observed in future inspections:

None AT This Time!

8. Recommended maintenance activities:

None AT This Time!

Sub-System Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 6/30/2022

Inspector May Environ (CD)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 5 / 11 / 2022

Inspector CD

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 4/20/2022

Inspector CD (Day Environm)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.3	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 3 / 2 / 2022

Inspector CCD (Day Environmental)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 2/1/2022

Inspector Day Enríquez Montal (CD)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 1/5/2022

Inspector CCD

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 12/09/2021

Inspector CD (Dey Environ mental)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 11/03/2024

Inspector CD (Dej Emerson minter)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 10/6/2021

Inspector CCD (Deej Emmanuel m)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 9/8/2021

Inspector Day Environmental (CCD)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 8/4/21

Inspector Jay Emmanuel (CD)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 7/2/24

Inspector by Environmental
CCJ

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 6/2/2021

Inspector CCD

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____



**CERTIFIED
RADON SYSTEMS**
lower levels. higher expectations.

MANOMETER READINGS

DATE: OCTOBER 4, 2021

FOR:

400 Main St.
Arcade, NY 14009

MANOMETER LOCATION	READING ON 10/4/21 ("WC)
1	0.6
2	0.5
3	0.5
4	0.4
5	0.2
6	0.5



CERTIFIED RADON SYSTEMS

lower levels. higher expectations.

MANOMETER REPORT

DATE: OCTOBER 4, 2021

FOR:

400 Main St.
Arcade, NY 14009

MANOMETER LOCATION	CHANGE IN READING 10/30/20-10/4/21 ("WC)
1	0
2	0
3	0
4	0
5	-~0.2
6	0

These changes in manometer readings reflect a minimal change in the negative pressure of each system. All systems are functioning as intended with sufficient air movement beneath the slab so as to be conducive of sufficient TCE remediation.



**CERTIFIED
RADON SYSTEMS**
lower levels. higher expectations.

MANOMETER READINGS

DATE: OCTOBER 4, 2021

MANOMETER LOCATION	READING ON 10/4/2021 ("WC)
358 Main St, Arcade, NY 14009	0.7
364 Main St, Arcade, NY 14009	1.9
372 Main St, Arcade, NY 14009	2.0



**CERTIFIED
RADON SYSTEMS**
lower levels. higher expectations.

MANOMETER READINGS

DATE: OCTOBER 4, 2021

MANOMETER LOCATION	CHANGE IN READING 10/30/20- 10/4/21 ("WC)
358 Main St, Arcade, NY 14009	0
364 Main St, Arcade, NY 14009	+~0.2
372 Main St, Arcade, NY 14009	0

These changes in manometer readings reflect a minimal change in the negative pressure of each system. This amount is most likely due to more or less water present underneath the slab. All systems are functioning as intended with sufficient air movement beneath the slab so as to be conducive of sufficient TCE remediation.