



ENVIRONMENTAL CONSULTATION & REMEDIATION

KPRG and Associates, Inc.

PERIODIC REVIEW REPORT

PERIOD: July 15, 2022 – July 15, 2023
SITE: Prestolite Plant Site, Arcade, New York (#961009)
DATE: August 9, 2023
SUBJECT: Post-Remediation Groundwater Monitoring and General Site Activities

1.0 INTRODUCTION

1.1 Site Summary

Detailed site characterization work was performed for this site from 1991 through 1995 which defined the subsurface geologic and hydrogeologic conditions along with various potential source areas of impact on the subject property.

The groundwater system beneath the site is comprised of two water bearing zones. The upper aquifer is generally under unconfined (water table) conditions. Depth to groundwater generally ranges from eight to ten feet below ground surface (bgs). Groundwater flow beneath the main portion of the Prestolite plant is in a north-northwesterly direction. The lower boundary of the upper aquifer is marked by a tight consistent silt layer of sufficiently low permeability to hydraulically separate the defined upper and lower aquifers. The lower aquifer consists of fine sands, and is confined. The lower boundary is marked by a mappable clay unit. The upper aquifer was determined to be impacted primarily with residual trichloroethene (TCE) and 1,1,1-trichloroethane (1,1,1-TCA). The lower aquifer was determined not to be impacted.

The remedial strategy included a phased approach to addressing each defined source area through a series of voluntary interim remedial measures (IRMs) which included direct removal or treatment. Separate IRM reports were issued for each source area documenting the effectiveness of the action(s) and that the established NYSDEC cleanup criteria were met. The NYSDEC issued a Record of Decision (ROD) in March 2000 which identified the combined IRMs as constituting the final site remedy and that no further remedial action was necessary. The residual groundwater impacts were to be addressed through monitored natural attenuation

(MNA). The ongoing monitoring program is specified in the Site Management Plan (SMP) dated November 11, 2014 for the Prestolite facility.

In March 2009, a sub-slab depressurization system was installed around the administration wing of the facility to address potential vapor intrusion issues. The system has been operating continuously since that time. The operation and maintenance requirements for this system are also included in the SMP. In June 2014, additional sub-slab depressurization systems were installed within a private residence and two commercial structures which are located adjacent to the north side of the Prestolite property. The three addresses are 372 W. Main Street (residence), 364 W. Main Street (Ward & Katzuba Law offices) and 358 W. Main Street (Davis Funeral Home). All three of these systems are operational at this time and as-builts have been submitted to the NYSDEC documenting the effectiveness of each system.

1.2 Effectiveness of Remedial Program

1.2.1 Progress Made During Reporting Period

During the reporting period of July 15, 2022 through July 15, 2023, the following activities were performed/completed at the site:

- Collection of two rounds of groundwater samples.
- Evaluation of groundwater flow conditions.
- Ongoing operation/maintenance activities.

The results of these activities are discussed in Sections 3.0 and 5.0 below.

In addition to the above progress, in a letter dated October 4, 2022, KPRG and Associates, Inc. (KPRG), on behalf of Motorola Solutions, Inc. (Motorola), requested that the semi-annual sampling program be reduced to annual sampling and that the number of monitoring wells sampled be reduced. The request outlined that the groundwater data that has been collected since 1992 has shown generally stable and/or improving conditions, all remedial activities have been completed with no ongoing sources of groundwater impacts, that appropriate controls are in place and there are no receptors at risk. In addition, there are consistently no detections of 1,1,1-TCA in any of the wells sampled and the only detections of TCE above the standard of 5 ug/l are at wells MW-01, MW-06A, MW-09 and MW-12. In summary, the request included reducing the sampling frequency to annual, and reducing the wells sampled to MW-01, MW-06A, MW-09 and MW-12, while continuing to obtain water levels from all wells. On October 21, 2022, the NYSDEC accepted the requested modification to the Site Management Plan. The December 2022 sampling represents the last

event for the semi-annual schedule, and the May 2023 sampling represents the first of the annual schedule.

1.2.2 Ability to Achieve Remedial Objectives

Based on the monitoring data presented in Section 3.0, the remedial actions that have been performed and the ongoing monitored natural attenuation data indicate that the remedial goals for the Site are being achieved. Groundwater impacts are stable to improving at all locations across the Site (see Section 3.1). The sub-slab venting systems installed for the administration wing of the facility and at three properties located along the north Prestolite property border (a residential property and two commercial properties) were documented to provide sufficient depressurization to mitigate vapor intrusion.

1.3 Compliance

1.3.1 Areas of Non-Compliance

During the reporting period, there were no areas of non-compliance.

1.3.2 Corrective Measures

Not applicable since there were no areas of non-compliance during the reporting period.

1.4 Recommendations

There are no recommended changes to the environmental monitoring program at this time.

2.0 SITE OVERVIEW

2.1 Site Description and Extent of Impacts Prior to Remediation

The Prestolite Leese-Neville facility is located at 400 Main Street in the Village of Arcade, New York. The manufacturing facility is within a commercial and residential area. A site map showing the location of the facility and surrounding land use is provided in Figure 1 in Attachment 1. The site investigation work identified several areas of volatile organic compound (VOC) impacted soils and sludges. In addition, several areas of metals (cadmium, chromium and lead) impacts to soil and sediment were also defined. The areas were:

- Run-off Receiving Area – Cadmium, chromium and lead impacted soils.
- Former Subsurface Weir Structure – Cadmium, chromium, lead, cyanide and VOC impacted sludges.

- Interior Subsurface Vault Structure – VOC impacted soils.
- Beneath Facility Foundation in the Vicinity of Former Degreasers – VOC impacted soils.
- Vicinity of Waste Water Treatment Plant – Cadmium, chromium and lead impacted soils.
- Vicinity of the Former Chemical Storage Building – VOC, cadmium, chromium and lead impacted soils.
- Cemetery Creek – Cadmium, chromium and lead impacted sediments.
- Beneath Facility Foundation in Vicinity of Administration Wing – VOC soil vapor.
- Beneath Foundations of a Residence and Two Commercial Structures North of the Prestolite Plant – Potential VOC soil vapor.

A map showing the locations of these areas is provided in Figure 2 in Attachment 1. Groundwater was documented to be primarily impacted with TCE, 1,1,1-TCA, cadmium, chromium and lead. Groundwater flow is in a north-northwesterly direction. The lateral extent of groundwater impacts was defined to reach the northwest property boundary. Additional off-site characterization determined that the minor impacts that have migrated past the site boundary have mixed with VOC impacts from other potential sources in the area. The vertical extent of impacts was determined to be limited to the upper aquifer as described in Section 1.1. The NYSDEC did not require further groundwater characterization.

2.2 General Chronology of Remediation Program

Between 1991 and 1999, various IRMs were implemented for the defined source areas of environmental impacts. The following IRMs were successfully completed, in the order provided, from first to most recent.

- Metals impacted soil removal from the Run-off Receiving Area for proper off-site disposal.
- Removal of VOC and metals impacted sediments for proper off-site disposal from a former subsurface weir structure located beneath the north parking lot. The structure was then cleaned and decommissioned.

- Removal of VOC impacted soils from within a former subsurface vault beneath the northwest portion of the manufacturing building for proper off-site disposal.
- Remediation of VOC impacted subsurface soils beneath the manufacturing building in the vicinity of two former degreasers using soil vapor extraction (SVE). The system was in operation for approximately 5 years, after which time verification soil samples were collected and determined that established cleanup objectives were met. The SVE system was decommissioned in 1999.
- Remediation of metals impacted soils in the vicinity of the waste water treatment building using on-site stabilization and capping.
- Remediation of VOC and metals impacted soils in the vicinity of the former chemical storage building using in-situ, thermally enhanced VOC stripping followed by metals stabilization and capping.
- Metals impacted sediment removal from Cemetery Creek for proper off-site disposal.
- Installation of a sub-slab depressurization system for the administration wing of the facility.
- Installation of sub-slab depressurization systems for a residence and two commercial structures located to the north of the Prestolite facility.

Separate IRM reports were issued for each source area remediation documenting the effectiveness of the action(s) and that the established NYSDEC cleanup criteria were met. The NYSDEC issued a Record of Decision (ROD) in March, 2000 which identified the combined IRMs as constituting the final site remedy and that no further remedial action was necessary. The only exception was the installation of the sub-slab depressurization system around the administration wing of the facility which was installed in 2009. Documentation of the installation was provided to the NYSDEC and subsequently approved as complete. The site is currently in groundwater monitoring mode to monitor the effectiveness of the various IRMs and track ongoing natural attenuation progress. A soil vapor intrusion study was performed and resulted in the installation of sub-slab depressurization systems beneath the administration wing of the plant (noted above), two off-site commercial buildings and an off-site residence. The NYSDEC approved completion of the soil vapor study aspects for the site in a memo dated May 15, 2015.

3.0 EVALUATION OF REMEDY PERFORMANCE, EFFECTIVENESS and PROTECTIVENESS

3.1 Semi-Annual/Annual Groundwater Monitoring Results

Groundwater samples were collected in November 2022 from wells MW-01, MW-01DA, MW-02A, MW-03, MW-05, MW-06A, MW-06DA, MW-07, MW-09, MW-09D, MW-11, MW-12, MW-13 and MW-14 and in May 2023 only from MW-01, MW-06A, MW-09 and MW-12. This represents the switch from the former program (semi-annual) to the new program (annual) as discussed in Section 1.3 above. The analytical results from the groundwater monitoring were used to gauge the effectiveness of remedial measures completed at the site.

Analytical data for the groundwater are summarized for VOCs and inorganics, respectively, in Tables 1 and 2 in Attachment 2. Sample locations are provided on Figure 2 in Attachment 1. The field sampling and analytical laboratory data packages are provided in Attachment 3. Plots of concentration versus time for representative VOCs detected at well locations are provided in Attachment 4.

A review of the VOC data in Table 1 and the time versus concentration plots in Attachment 4 indicates steady to decreasing trends in VOC concentrations at all well locations. It is noted that at this point there are consistently no detections of 1,1,1-TCA in groundwater at any of the well locations. The only detections of TCE above the 5 ug/l groundwater standard are at wells MW-01, MW-06A, and MW-12, with concentrations from the May 2023 sampling event being 8.4, 6.9, and 7.5 ug/l, respectively. The TCE concentration for well MW-9 was 4.9 ug/l, which represents the lowest concentration for that well.

A review of metals data in Table 2 indicates that for the last two rounds of sampling, there were low level detections of total lead and/or chromium at several well locations (MW-01, MW-03, MW-05, MW-06DA, MW-09, MW-09D and MW-14). However, the dissolved metals analyses at these locations showed no detections of metals indicating that the detections were associated with the suspended sediment load within the sample and were not mobile within the groundwater system.

Based on the above-presented groundwater monitoring data, the source mitigation/control remedial actions performed at this site have been effective and groundwater quality conditions generally continue to improve with ongoing natural attenuation.

3.2 Evaluation of Groundwater Flow Conditions

The groundwater levels collected during the two sampling events are provided with the data packages in Attachment 3. It is noted that although there is a reduced number of wells sampled with the annual program, wells MW-01, MW-01DA, MW-02A, MW-03, MW-06A, MW-06DA, MW-07, MW-09, MW-09D, MW-11, MW-12, MW-13 and MW-14 are utilized for water levels. The water levels were used to generate groundwater elevation contour maps for each sampling event which are provided as Figures 3 and 4 in Attachment 1. A review of the figures indicates that the flow conditions are consistent with historic patterns for the site with a northerly to northwesterly groundwater flow beneath the facility. Based on this observation, the updated groundwater monitoring well network is sufficient for ongoing monitoring.

4.0 IC/EC PLAN COMPLIANCE REPORT

4.1 IC/EC Requirements and Compliance

The following Institutional Control (IC) and Engineering Controls (ECs) are in place at this site:

- IC – A groundwater use restriction has been placed for this site.
- ECs – Monitoring wells, cover system and vapor mitigation systems.

The IC and ECs are discussed separately below.

4.1.1 Groundwater Use Restriction

To preclude potential future use of groundwater beneath the site, a groundwater use restriction was placed on the property deed. The restriction is on file at the Wyoming County Registrar of Deeds. No groundwater wells have been installed at the site with the exception of the environmental monitoring wells.

4.1.2 Monitoring Wells

The revised environmental monitoring program approved for the site consists of annual groundwater sampling of monitoring wells MW-01, MW-06A, MW-09, and MW-12. These wells are inspected for integrity concurrently with each sampling event (see Section 6.1).

4.1.3 Soil Cover and Drainage Control

Since metals impacted soils in the vicinity of the waste water treatment plant and former chemical storage building were treated via stabilization and remain in-situ, a soil cover was placed over the treated soils to prevent

potential direct contact exposure and preclude erosional runoff into the adjoining Cemetery Creek. In addition, a drainage swale was constructed uphill of the area to direct surface runoff to the west, around the cover area to further assist in erosion control and minimize infiltration.

The soil cover, drainage swale and the adjoining banks of Cemetery Creek are inspected regularly as part of ongoing operation and maintenance (O&M) activities. To date, the ECs installed have been functioning as designed. Historically only minor cover repairs have been required. The controls continue to function effectively and as designed.

Routine semi-annual inspections of the drainage control and cover system are completed by Prestolite plant personnel (See Sections 6.2 and 6.3).

4.1.4 Vapor Mitigation

Sub-slab depressurization systems (SSDSs) were installed as part of vapor mitigation requirements beneath the administrative wing of the Prestolite facility at 400 Main Street and three private properties to the north with addresses of 372, 364 and 358 Main Street. The 372 Main Street property includes a private residence and the other two properties are former residences converted to commercial use including legal offices and a funeral home. Routine inspection of the Prestolite plant system is completed by plant personnel on a monthly basis and annually by the installation contractor. The off-site SSDS installations are inspected on an annual basis by the installation contractor (See Section 6.4).

4.2 IC/EC Certification

The required annual IC/EC Certification is provided in Attachment 5.

5.0 MONITORING PLAN COMPLIANCE REPORT

The revised environmental monitoring program approved for the site consists of annual groundwater sampling of existing monitoring wells MW-01, MW-06A, MW-09, and MW-12. All samples collected are analyzed for VOCs and total/dissolved cadmium, chromium and lead. The results of the most recent monitoring along with all historical monitoring data and associated conclusions/recommendations are provided in Section 3.0. The facility is in compliance with monitoring requirements and there are no deficiencies.

6.0 OPERATION AND MAINTENANCE PLAN COMPLIANCE

The following four O&M activities are currently being performed:

- Inspection and maintenance of monitoring wells.
- Inspection of Cemetery Creek along the length of the subject property to evaluate potential evidence of bank/sidewall erosion into the stabilized soil mass.
- Inspection and maintenance of soil cover and upgradient drainage swale.
- Inspection of sub-slab depressurization systems.

The results of each inspection are discussed separately below.

6.1 Monitoring Well Inspection and Maintenance

As part of groundwater sampling activities, the integrity of each monitoring well was inspected. Previous discussions with the sampling contractor indicated that the flush mount vault for well MW-13 was found in poor condition and the concrete apron at well MW-14 was noted to be loose. These items were fixed on August 8, 2022 when the contractor replaced the flush mount vault and concrete apron for both of the wells. Photos of the repair work are included in Attachment 6. The wells (concrete aprons and protectors) were found to be in good condition during the May 2023 round of sampling.

6.2 Cemetery Creek Inspection

Mr. James Bodensteiner of Prestolite performed the required inspections of Cemetery Creek. Copies of the inspection forms are provided in Attachment 6. The inspections indicated one-half channel flow during the December 2022 inspection and one-quarter channel flow during the June 2023 inspection. During both inspections, there was no indication of accumulated debris causing blockage. The channel walls/banks were in good condition and there were no other comments or observations.

6.3 Soil Cover and Drainage Swale Inspection

The required soil erosion prevention inspections were also performed by Mr. James Bodensteiner. Copies of the inspection forms are included in Attachment 6. The inspection found all aspects of the soil cover and drainage swale to be in good condition. No rill development issues were identified along the banks. The upgradient drainage swale was in good condition. No other substantive inspection comments were provided.

6.4 Sub-slab Depressurization System Inspection

Monthly inspections of the sub-slab depressurization system were performed by Prestolite contractor, Day Environmental. Copies of the inspection forms are

provided in Attachment 6. The system was found to be in good operating condition throughout the reporting period. In addition, representatives from KPRG, Motorola and the NYSDEC completed an inspection in the Fall of 2022. During that inspection, the horizontal section of one of the SSDS vent piping sections appeared to be sagging. Certified Radon Systems (CRS; system installer) was able to repair the piping. A picture of the repaired vent pipe is in Attachment 6. The manometer readings collected by CRS are also included in Attachment 6.

On October 13, 2022, an annual sub-slab depressurization system check was also made of the systems installed at one residence and two commercial properties located at 372, 364 and 358 Main Street, respectively. The inspections were completed by CRS which was the contractor that installed the systems. The systems were found in good operational condition with the exception of 372 Main St as the resident has been unavailable to allow access. Attempts will continue to allow access for the upcoming annual report. The manometer readings are provided in Attachment 6 as well as a table of any changes in manometer readings from the previous year.

7.0 OVERALL CONCLUSIONS AND RECOMMENDATIONS

Based on the data and information presented in this Periodic Progress Report, the following conclusions and recommendations are forwarded:

- All aspects of the current monitoring program and associated site ICs and ECs are in compliance.
- There are no recommended changes to the ICs or ECs.
- The monitoring data presented in this report documents that the remedial strategy implemented for this site has met performance standards and continues to be effective as indicated by the stable to improving MNA groundwater conditions. No changes to the monitoring program are recommended at this time.
- Progress reports are presently being submitted on an annual basis. No change in submittal frequency is proposed at this time.

ATTACHMENT 1

Figures



0 300'
APPROXIMATE SCALE

ENVIRONMENTAL CONSULTATION & REMEDIATION

K P R G

KPRG and Associates, Inc.

14665 West Lisbon Road, Suite 2B Brookfield, Wisconsin 53005 Telephone 262-781-0475 Facsimile 262-781-0478

414 Plaza Drive, Suite 106 Westmont, Illinois 60559 Telephone 630-325-1300 Facsimile 630-325-1593

SITE AREA MAP


Prestolite Leece - Neville Site
Arcade, New York

Scale: 1" = 300' Date: July 14, 2016

KPRG Project No. 21803.8

FIGURE 1

w:\Projects\Motorola\Arcade 2022\2022 annual report gw maps.dwg

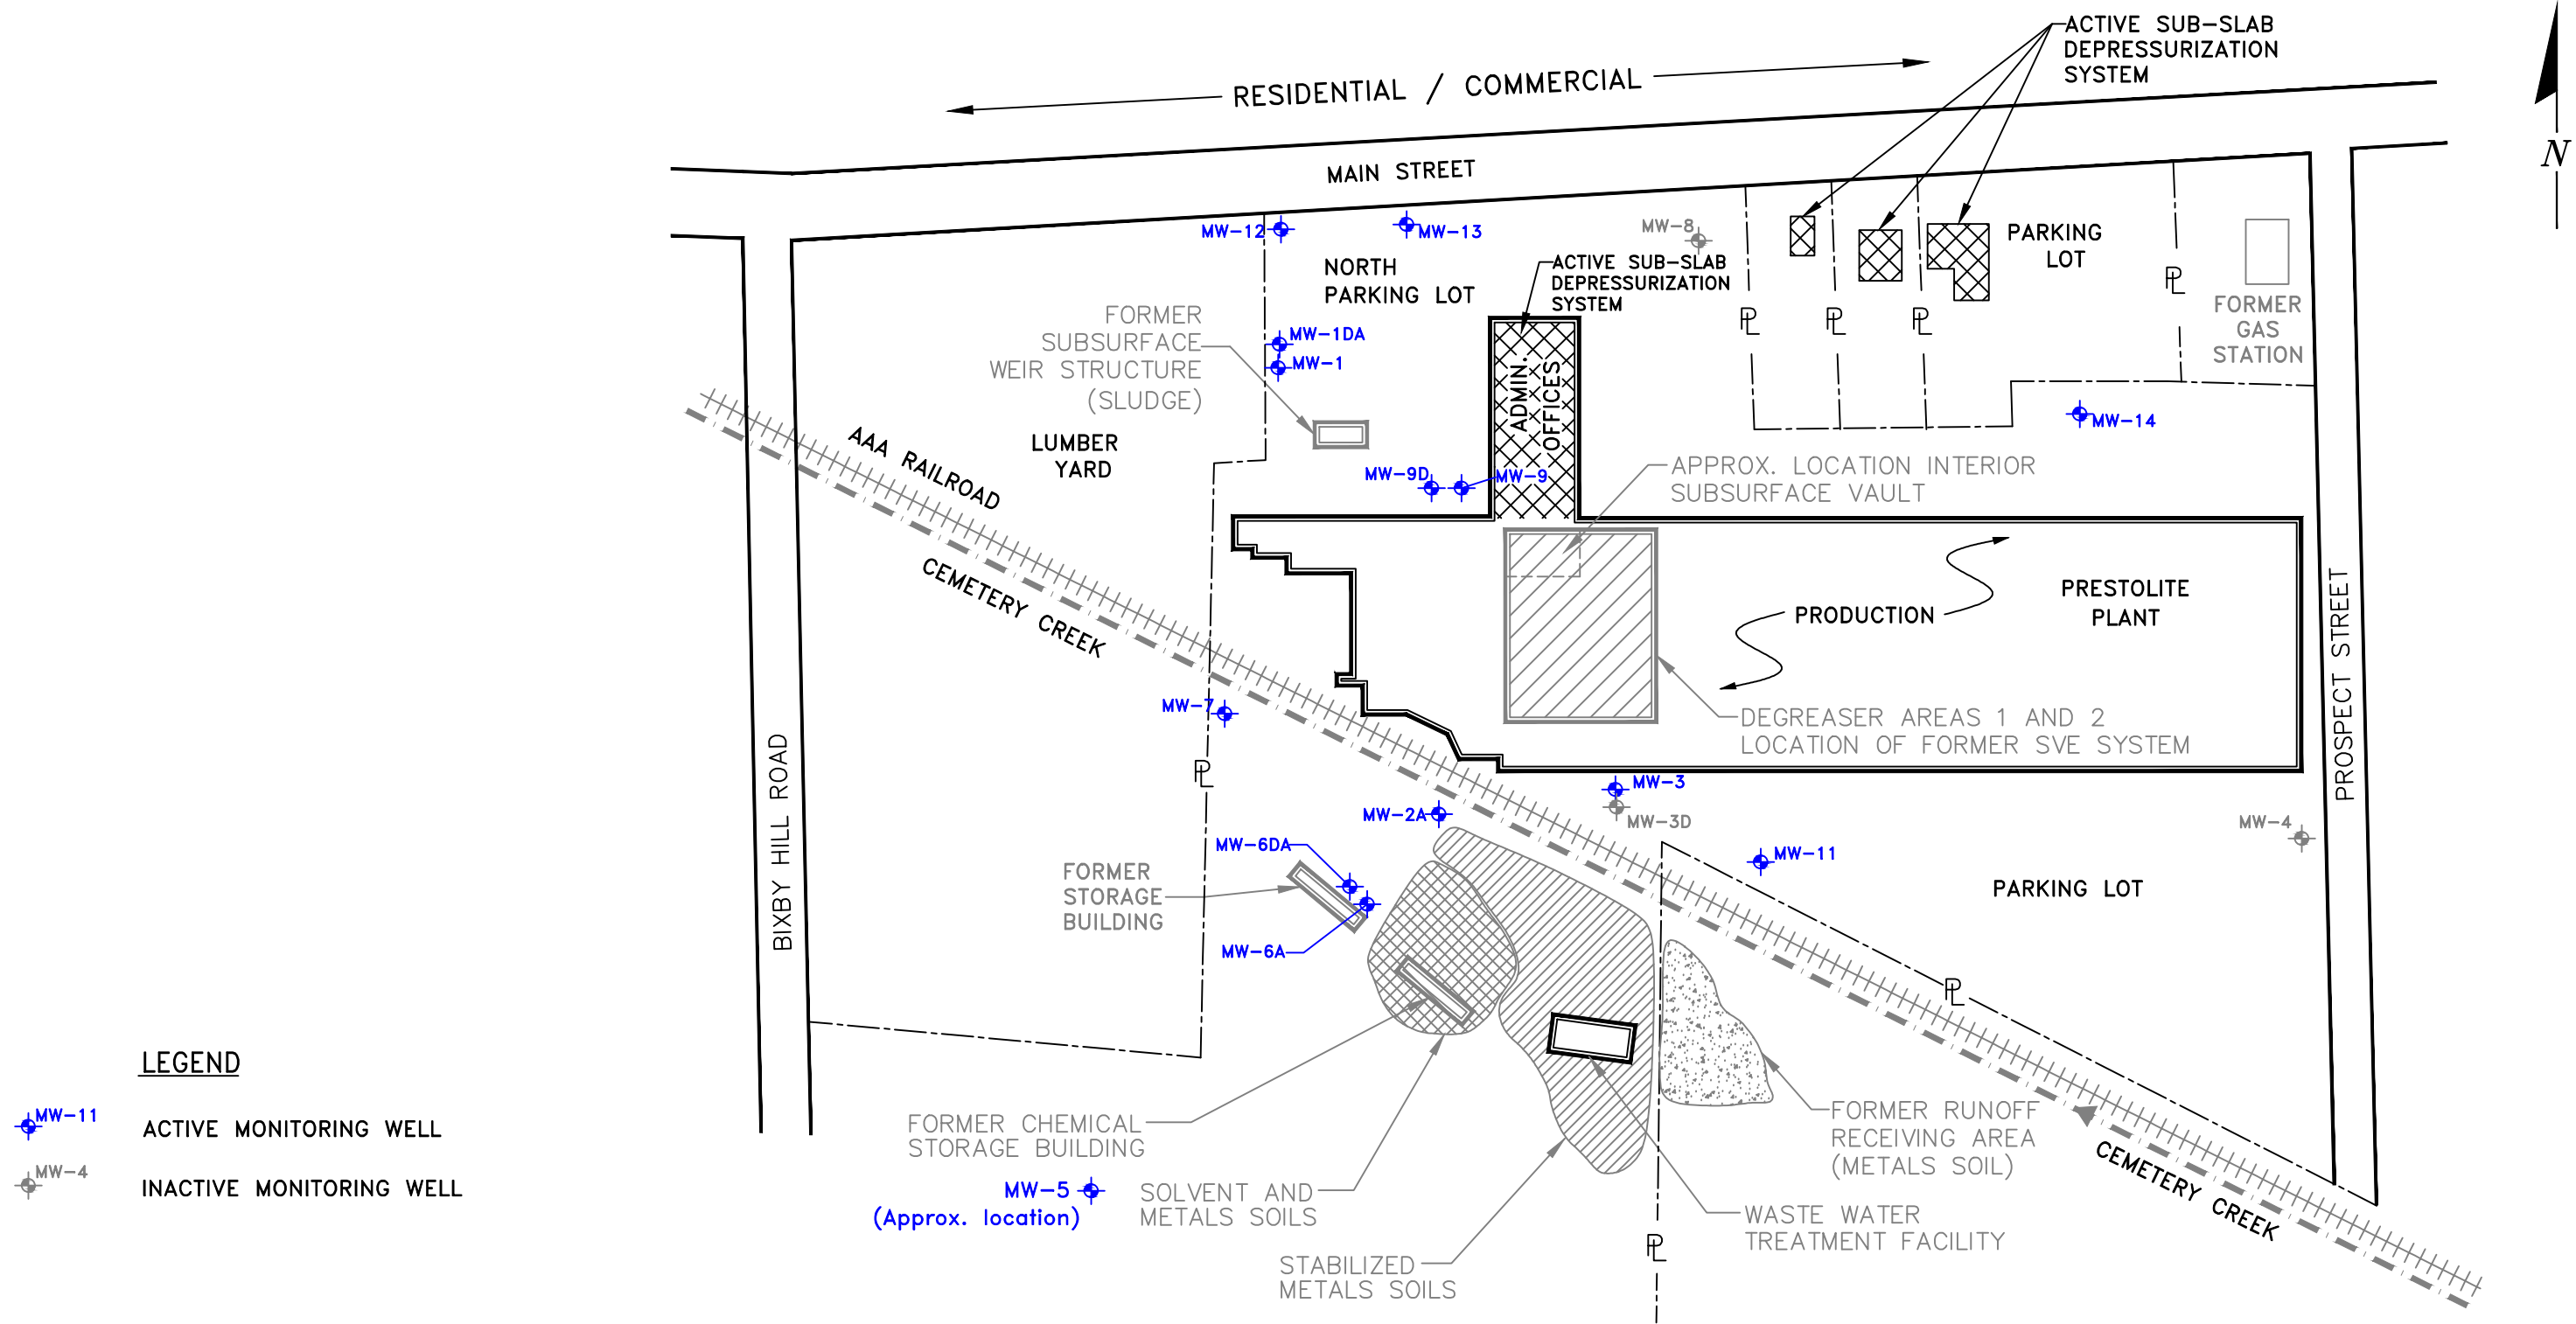

ENVIRONMENTAL CONSULTATION & REMEDIATION

K P R G

KPRG and Associates, inc.

14665 West Lisbon Road, Suite 1A Brookfield, Wisconsin 53005 Telephone 262-781-0475 Facsimile 262-781-0478

414 Plaza Drive, Suite 106 Westmont, Illinois 60559 Telephone 630-325-1300 Facsimile 630-325-1593

All locations and dimensions are approximate.

GROUNDWATER MONITORING WELL LOCATIONS

Motorola, Inc., Presolite Plant
Arcade, New York

Scale: 1" = 200'


Date: August 2, 2022

KPRG Project No. 21803.18

FIGURE 2

GROUNDWATER ELEVATIONS (ft msl)	
MW-1	1464.86
MW-2A	1470.61
MW-3	TBD
MW-5	1561.55
MW-6A	1470.55
MW-7	1472.50
MW-9	1467.18
MW-11	TBD
MW-12	1464.16
MW-13	1464.27
MW-14	1467.17

-  MW-11
- ACTIVE MONITORING WELL
-  MW-4
- INACTIVE MONITORING WELL
- 
- GROUNDWATER CONTOUR
- 
- FLOWLINE

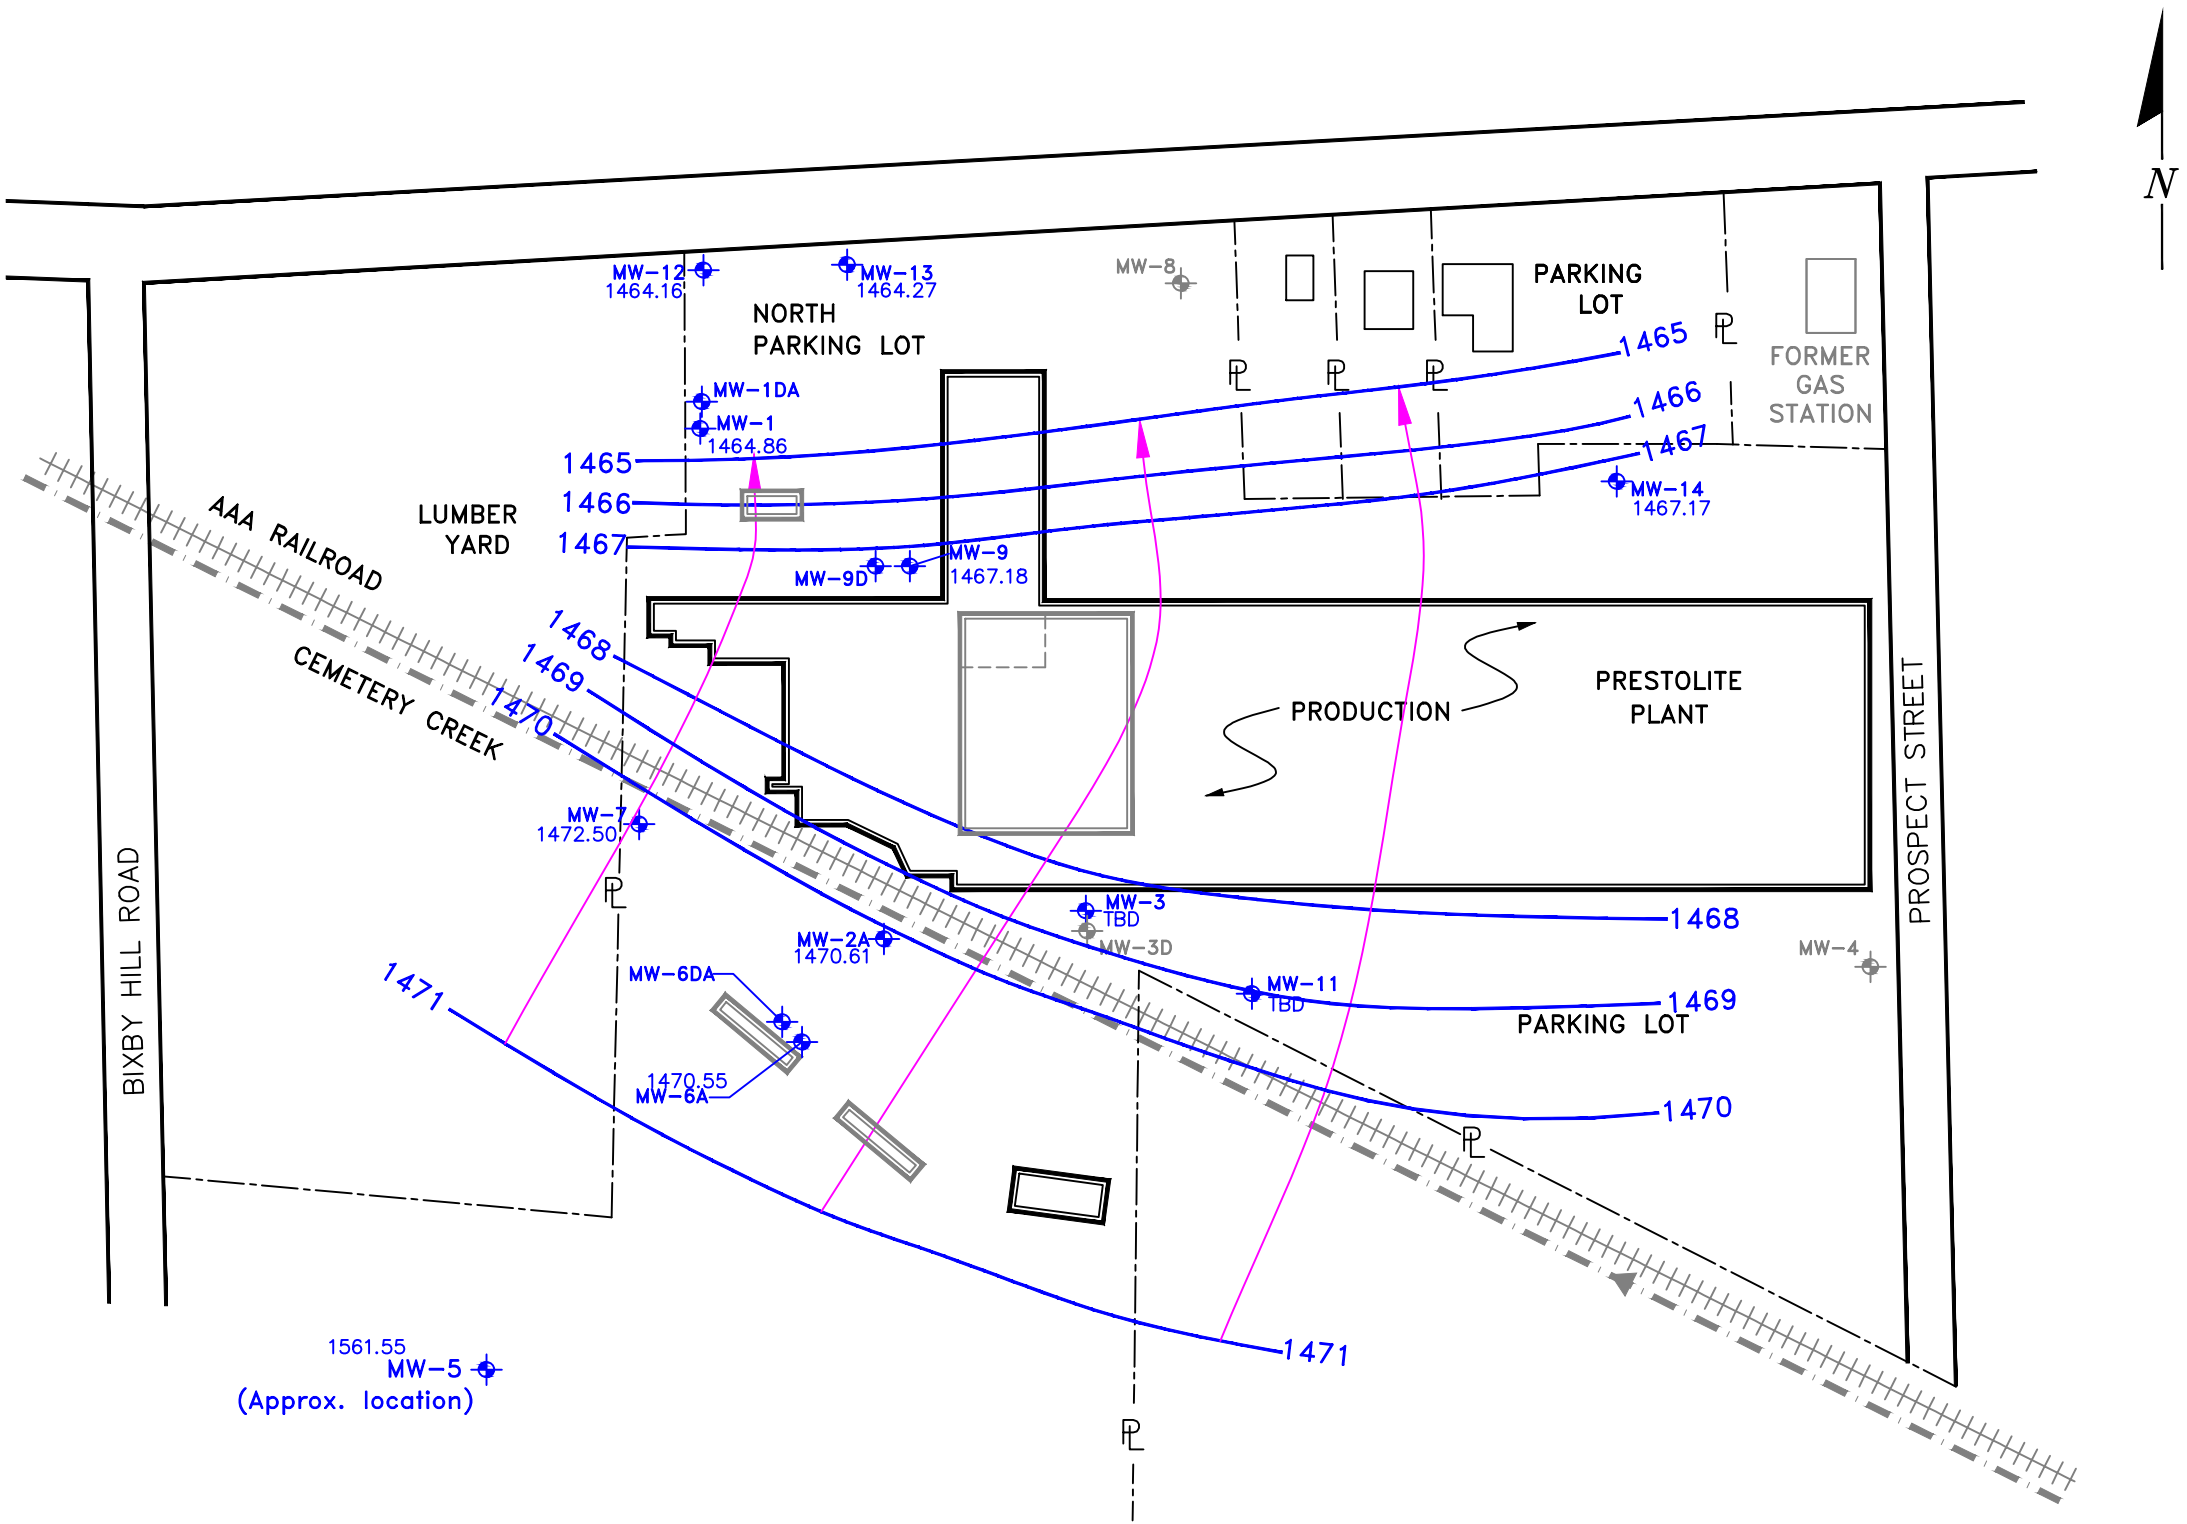

0 200'
APPROXIMATE SCALE

ENVIRONMENTAL CONSULTATION & REMEDIATION

K P R G

KPRG and Associates, inc.

14665 West Lisbon Road, Suite 1A Brookfield, Wisconsin 53005 Telephone 262-781-0475 Facsimile 262-781-0478

414 Plaza Drive, Suite 106 Westmont, Illinois 60559 Telephone 630-325-1300 Facsimile 630-325-1593

GROUNDWATER CONTOUR MAP 12/2022

Motorola, Inc., Presolite Plant
Arcade, New York


Scale: 1" = 200' Date: July 13, 2023

KPRG Project No. 21803.18 FIGURE 3

All locations and dimensions are approximate.

GROUNDWATER ELEVATIONS (ft msl)	
MW-1	1464.52
MW-2A	1469.30
MW-3	1468.28
MW-5	NM
MW-6A	1469.55
MW-7	1469.64
MW-9	1466.69
MW-11	1468.45
MW-12	1463.82
MW-13	1463.96
MW-14	1466.48

-  MW-11
- ACTIVE MONITORING WELL
-  MW-4
- INACTIVE MONITORING WELL
- 
- GROUNDWATER CONTOUR
- 
- FLOWLINE

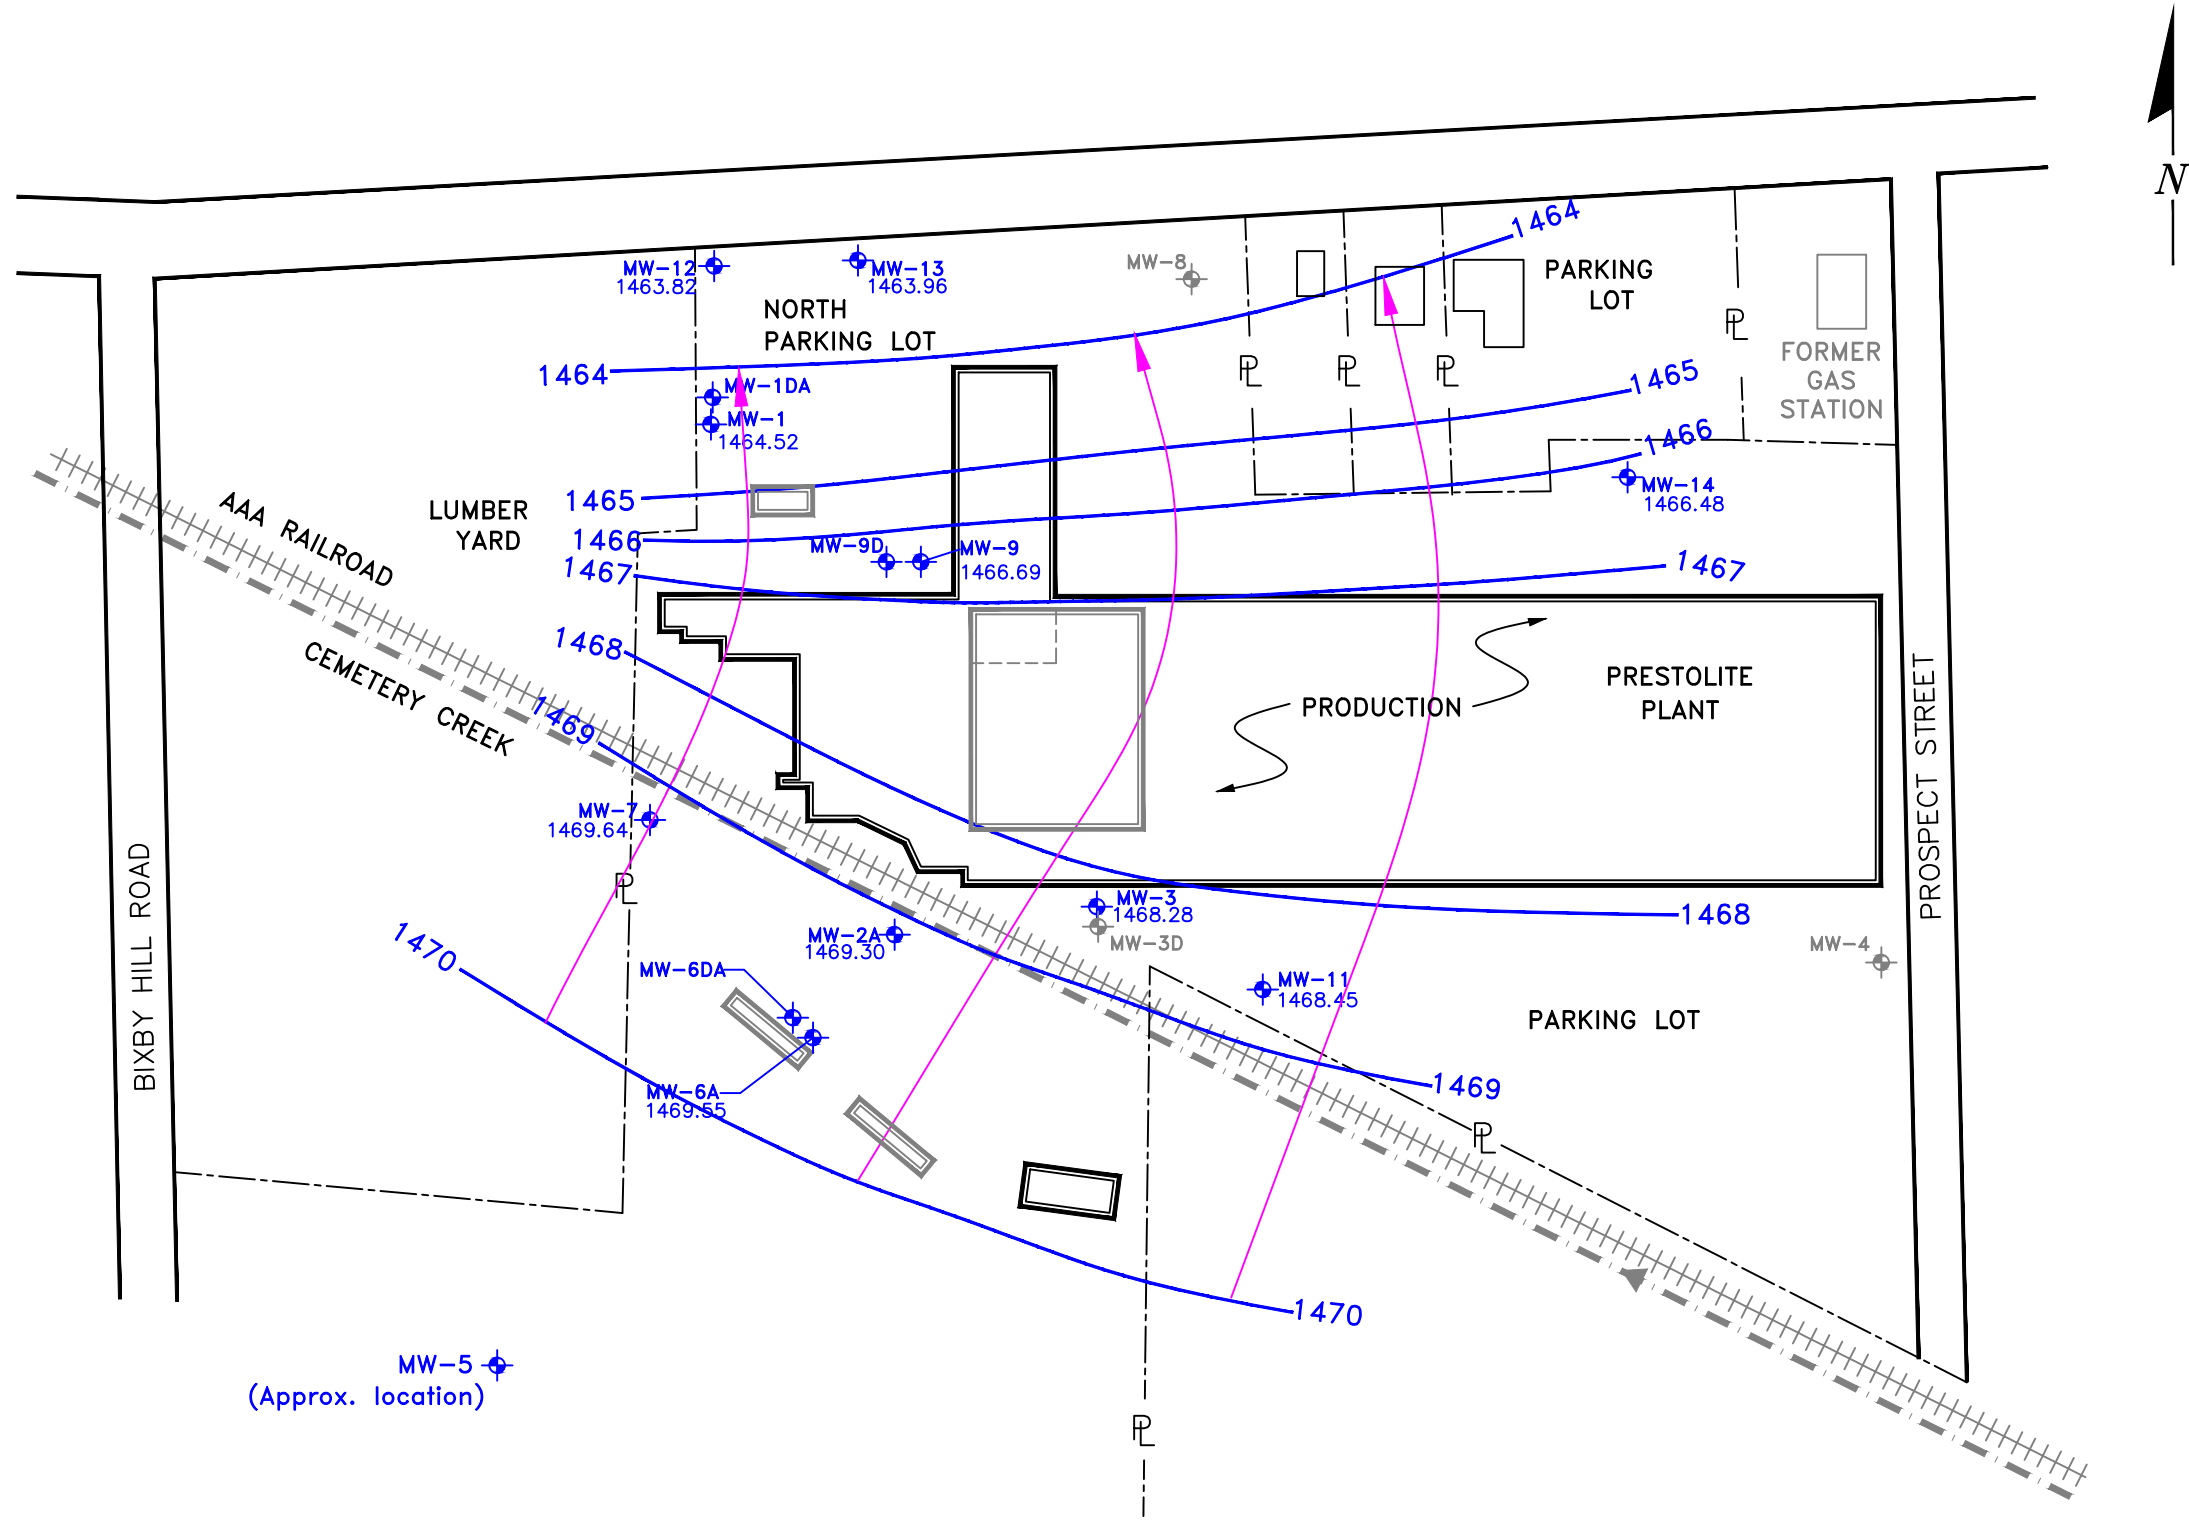

MW-5 (Approx. location)



ENVIRONMENTAL CONSULTATION & REMEDIATION

K P R G

KPRG and Associates, inc.

14665 West Lisbon Road, Suite 1A Brookfield, Wisconsin 53005 Telephone 262-781-0475 Facsimile 262-781-0478

414 Plaza Drive, Suite 106 Westmont, Illinois 60559 Telephone 630-325-1300 Facsimile 630-325-1593

GROUNDWATER CONTOUR MAP 5/2023

Motorola, Inc., Presolite Plant
Arcade, New York

Scale: 1" = 200'

Date: June 28, 2023

KPRG Project No. 21803.18

FIGURE 4

All locations and dimensions are approximate.

I:\SERVER2\Common\Projects\Motorola\Arcade 2021

ATTACHMENT 2

Tables

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethane	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled												
MW-01 (Relocated 12/99)	2/92	--	--	--	--	120	17	--	--	--	--	--	--
	10/92	--	--	--	--	130	19	--	--	--	--	--	--
	6/93	--	--	--	--	100	12	--	--	--	--	--	--
	11/93	(0.9) BJ	--	--	--	110 B	12	--	--	--	--	--	--
	5/94	--	--	--	--	98	9	--	--	--	--	--	--
	1/95	--	--	--	--	76	7 J	--	--	--	--	--	--
	6/95	--	--	--	--	90	7 J	--	--	--	--	--	--
	9/95	--	--	--	--	110	8 J	--	--	--	--	--	--
	11/95	--	--	--	--	140	9 J	--	--	--	--	--	--
	3/96	--	--	--	--	96	5 J	--	--	--	--	--	--
	6/96	--	--	--	--	100	6 J	--	--	--	--	--	--
	9/96	--	--	--	--	98	7 J	--	--	--	--	--	--
	12/96	--	--	--	--	91	7 J	--	--	--	--	--	--
	2/97	--	--	--	--	79	5 J	--	--	--	--	--	--
	4/97	--	--	--	--	70	4 J	--	--	--	--	--	--
	7/97	--	--	--	--	88	6 J	--	--	--	--	--	--
	10/97	--	--	--	--	90	6 J	--	--	--	--	--	--
	1/98	--	--	--	--	78	4 J	--	--	--	--	--	--
	8/98	--	--	--	--	84	5 J	--	--	--	--	--	--
	1/99	--	--	--	--	54	4 J	--	--	--	--	--	--
	7/99	--	--	--	--	55	4 J	--	--	--	--	--	--
	12/99	--	--	--	--	67	4.6	0.49 J	--	--	--	--	--
	1/00	--	--	--	--	23	35	2 J	--	--	--	--	--
	8/00	--	--	--	--	3J	38	2 J	--	--	--	--	--
	1/01	--	--	--	--	--	40	3 J	--	--	--	--	--
	8/01	2BJ	--	--	--	--	40	3 J	--	--	--	--	--
	1/02	--	--	--	--	--	37	2 J	--	--	--	--	--
	8/02	1BJ	--	--	3BJ	2BJ	37	2 J	--	--	--	--	--
	1/03	--	--	--	--	--	25	2 J	--	--	--	--	--
	7/03	--	--	--	--	--	34	2 J	--	--	--	--	--
	1/04	--	--	--	--	--	21	--	--	--	--	--	--
	8/04	--	--	--	--	--	35	2 J	--	--	--	--	--
	1/05	--	--	--	--	--	21	--	--	--	--	--	--
	7/05	--	--	--	--	--	27	2 J	--	--	2BJ	9BJ	--
	1/06	--	--	--	--	--	24	2 J	--	--	--	--	--
	8/06	--	--	--	--	1J	27	2 J	--	--	--	--	--
	1/07	--	--	--	--	--	22	1 J	--	--	--	--	--
	7/07	--	--	--	--	--	23	1 J	--	--	--	--	--
	1/08	--	--	--	--	--	20	1 J	--	--	--	--	--
	7/08	--	--	--	--	--	24	1 J	--	--	--	--	--
	1/09	--	--	--	--	--	19	--	--	--	--	--	--
	7/09	--	--	--	--	--	23	1 J	--	--	--	--	--
	2/10	--	--	--	--	--	17	0.84 J	--	--	--	--	--
	8/10	--	--	--	--	--	21	--	--	--	--	--	--
	1/11	--	--	--	--	--	16	--	--	--	--	--	--
	8/11	--	--	--	--	--	23	--	--	--	--	--	--
	1/12	--	--	--	--	--	15	--	--	--	--	--	--
	8/12	--	--	--	--	--	20	--	--	--	--	--	--
	1/13	--	--	--	--	--	16	--	--	--	--	--	--
	8/13	--	--	--	--	--	18	--	--	--	--	--	--
1/14	--	--	--	--	--	13	--	--	--	--	--	--	
8/14	--	--	--	--	--	17	--	--	--	--	--	--	
1/15	--	--	--	--	--	14	--	--	--	--	--	--	
7/15	--	--	--	--	--	13	--	--	--	--	--	--	
1/16	--	--	--	--	--	12	--	--	--	--	--	--	
7/16	--	--	--	--	--	15	--	--	--	--	--	--	
1/17	--	--	--	--	--	11	--	--	--	--	--	--	
7/17	--	--	--	--	--	13	--	--	--	--	--	--	
1/18	--	--	--	--	--	12	--	--	--	--	--	--	
8/18	--	--	--	--	--	14	--	--	--	--	--	--	
6/19	--	--	--	--	--	8.1 J	--	--	--	--	--	--	
11/19	--	--	--	--	--	9.5 J	--	--	--	--	--	--	
6/20	--	--	--	--	3.5 J	10	--	--	--	--	--	--	
12/20	--	--	--	--	--	13	--	--	--	--	--	--	
4/21	--	--	--	--	--	11	--	--	--	--	--	--	
11/21	--	--	--	--	--	14	--	--	--	--	--	--	
6/22	--	--	--	--	--	11	--	--	--	--	--	--	
12/22	--	--	--	--	--	13	--	--	--	--	--	--	
5/23	--	--	--	--	--	8.4 J	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled												
MW-01DA	1/95	--	--	--	110	--	--	--	--	--	--	--	--
	6/95	--	--	--	120	--	--	--	--	--	--	--	--
	9/95	--	--	--	--	--	--	--	--	--	--	--	--
	11/95	--	--	--	--	--	--	--	--	--	--	--	--
	3/96	--	--	--	76	--	--	--	--	--	--	--	--
	6/96	--	--	--	8 J	--	--	--	--	--	--	--	--
	9/96	--	--	--	--	--	--	--	--	--	--	--	--
	12/96	--	--	--	--	--	--	--	--	--	--	--	--
	2/97	--	--	--	--	--	--	--	--	--	--	--	--
	4/97	--	--	--	--	--	--	--	--	--	--	--	--
	7/97	--	--	--	--	--	--	--	--	--	--	--	--
	10/97	--	--	--	--	--	--	--	--	--	--	--	--
	1/98	--	--	--	--	--	--	--	--	--	--	--	--
	8/98	--	--	--	--	--	--	--	--	--	--	--	--
	1/99	--	--	--	--	--	--	--	--	--	--	--	--
	7/99	--	--	--	--	--	--	--	--	--	--	--	--
	12/99	--	--	--	--	--	--	--	--	--	--	--	--
	1/00	--	--	--	4 J	--	--	--	--	--	--	--	--
	8/00	--	--	--	--	--	--	--	--	--	--	--	--
	1/01	--	--	--	--	--	--	--	--	--	--	--	--
	8/01	--	--	--	--	--	--	--	--	--	--	--	--
	1/02	--	--	--	--	--	--	--	--	--	--	--	--
	8/02	--	--	4BJ	3BJ	--	--	--	--	--	--	--	--
	1/03	--	--	--	--	--	--	--	--	--	--	--	--
	7/03	--	--	--	--	--	--	--	--	--	--	--	--
	1/04	--	--	--	--	--	--	--	--	--	--	--	--
	8/04	--	--	--	--	--	--	--	--	--	--	--	--
	1/05	--	--	--	--	--	--	--	--	--	--	--	--
	7/05	--	--	--	--	--	--	--	--	--	--	6BJ	--
	1/06	--	--	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	--	--	--	--	--	--	--	--
	1/07	--	--	--	--	--	--	--	--	--	--	--	--
	7/07	--	--	--	--	--	--	--	--	--	--	--	--
	1/08	--	--	--	--	--	--	--	--	--	--	--	--
	7/08	--	--	--	--	--	--	--	--	--	--	--	--
	1/09	--	--	--	--	--	--	--	--	--	--	--	--
	2/10	--	--	--	--	--	--	--	--	--	--	--	--
	8/10	--	--	--	--	--	--	--	--	--	--	--	--
	1/11	--	--	--	--	--	--	--	--	--	--	--	--
	8/11	--	--	--	--	--	--	--	--	--	--	--	--
	1/12	--	--	--	--	--	--	--	--	--	--	--	--
	8/12	--	--	--	--	--	--	--	--	--	--	--	--
1/13	--	--	--	--	--	--	--	--	--	--	--	--	
8/13	--	--	--	--	--	--	--	--	--	--	--	--	
1/14	--	--	--	--	--	--	--	--	--	--	--	--	
8/14	--	--	--	--	--	--	--	--	--	--	--	--	
1/15	--	--	--	--	--	--	--	--	--	--	--	--	
7/15	--	--	--	--	--	--	--	--	--	--	--	--	
1/16	--	--	--	--	--	--	--	--	--	--	--	--	
7/16	--	--	--	--	--	--	--	--	--	--	--	--	
1/17	--	--	--	--	--	--	--	--	--	--	--	--	
7/17	--	--	--	--	--	--	--	--	--	--	--	--	
1/18	--	--	--	--	--	--	--	--	--	--	--	--	
8/18	--	--	--	--	--	--	--	--	--	--	--	--	
6/19	--	--	--	--	--	--	--	--	--	--	--	--	
11/19	--	--	--	--	--	--	--	--	--	--	--	--	
6/20	--	--	--	--	--	--	--	--	--	--	--	--	
12/20	--	--	--	--	--	--	--	--	--	--	--	--	
4/21	--	--	--	--	--	--	--	--	--	--	--	--	
11/21	--	--	--	--	--	--	--	--	--	--	--	--	
6/22	--	--	--	--	--	--	--	--	--	--	--	--	
12/22	--	--	--	--	--	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L												
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethane	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone	
Well Number	Date Sampled	1/95	7 J	--	--	16	17	2 J	24	--	10	41	93	--
		6/95	180 D	2 J	--	66	14	--	62	1 J	67	160	850	--
MW-02A	9/95	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	11/95	--	--	--	--	3 J	--	--	--	--	--	--	--	--
	3/96	--	--	--	--	--	--	--	--	--	--	--	--	--
	6/96	22	--	--	4J	--	--	28	--	4J	36	220	--	--
	9/96	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	12/96	--	--	--	--	--	--	--	--	--	--	--	--	--
	2/97	--	--	--	--	--	--	6J	--	1J	--	1J	--	--
	4/97	3J	--	--	--	--	--	10	--	5J	4J	51	--	--
	7/97	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	10/97	8J	NS	NS	7J	NS	NS	20	NS	6J	12	95	NS	NS
	1/98	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/98	20B	--	--	30	3J	--	16	--	2J	51	320	--	--
	1/99	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	7/99	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/00	18	NS	NS	110	2J	NS	17	NS	5J	24	180	NS	NS
	1/01	1J	--	--	--	--	--	2J	--	--	--	8J	--	--
	1/02	3J	--	--	13	1J	--	7J	--	1J	--	33	2J	--
	1/03	6J	--	--	--	2J	--	6J	--	--	15	84	--	--
	7/03	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/04	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/04	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/05	--	--	--	--	--	--	--	--	--	--	--	--	--
	7/05	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/06	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	2J	--	--	--	--	--	--	--	--
	1/07	3J	--	--	2J	2J	--	4J	--	1J	6J	41	--	--
	7/07	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/08	--	--	--	--	--	--	--	--	--	--	--	--	--
	7/08	--	--	--	--	--	--	2J	--	--	1J	--	--	--
	1/09	--	--	--	--	1.3J	--	--	--	--	--	--	--	--
	7/09	--	--	--	1.9J	1.5J	--	1.8J	--	--	0.99J	14	--	--
	2/10	--	--	--	--	2.3J	--	--	--	--	--	--	--	--
	8/10	--	--	--	2.8J	--	--	2.2J	--	--	20	100	--	--
	1/11	--	--	--	--	2.4J	--	--	--	--	--	--	--	--
	8/11	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/12	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/12	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/13	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/13	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	1/14	--	--	--	--	--	--	--	--	--	--	--	--	--
8/14	--	--	--	2.7J	--	--	--	--	--	--	--	--	--	
1/15	--	--	--	--	--	--	--	--	--	--	--	--	--	
7/15	--	--	--	--	--	--	2.1J	--	--	--	--	--	--	
1/16	--	--	--	--	--	--	--	--	--	--	--	--	--	
7/16	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	
1/17	--	--	--	--	--	--	--	--	--	--	--	--	--	
7/17	--	--	--	--	0.87J	--	1.2J	--	--	--	--	--	--	
1/18	--	--	--	--	--	--	--	--	--	--	--	--	--	
8/18	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	
6/19	--	--	--	--	1.8J	--	--	--	--	--	--	--	--	
11/19	--	--	--	--	0.93 J	--	--	--	--	--	--	--	--	
6/20	--	--	--	--	1.6 J	--	2.3 J	--	--	--	--	--	--	
12/20	--	--	--	--	1.4 J	--	--	--	--	--	--	--	--	
4/21	--	--	--	--	1.5 J	--	--	--	--	--	--	--	--	
11/21	--	--	--	--	1.9 J	--	--	--	--	--	--	--	--	
6/22	--	--	--	3.7J	1.9J	--	2.9J	--	--	--	--	--	--	
12/22	--	--	--	--	0.93J	--	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L												
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethane	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone	
Well Number	Date Sampled	2/92	--	--	--	--	22	6	--	--	--	--	--	--
MW-03	10/92	--	--	--	--	--	25	7 J	5 J	--	--	--	--	--
	6/93	--	--	--	--	--	19	4 J	2 J	--	--	--	--	--
	11/93	(0.6) BJ	--	--	--	--	13 B	2 J	--	--	--	--	--	--
	5/94	--	--	--	--	--	27	7	1 J	--	--	--	--	--
	1/95	--	--	--	--	--	20	--	1 J	--	--	--	--	--
	6/95	--	--	--	--	--	12	2 J	7 J	--	--	--	--	--
	9/95	--	--	--	--	--	4 J	--	1 J	--	--	--	--	--
	11/95	--	--	--	--	--	6 J	--	3 J	--	--	--	--	--
	3/96	--	--	--	--	--	10	--	--	--	--	--	--	--
	6/96	--	--	--	--	--	29	5J	2J	--	--	--	--	--
	9/96	--	--	--	--	--	3J	--	1J	--	--	--	--	--
	12/96	--	--	--	--	--	6J	--	7J	--	--	--	--	--
	2/97	--	--	--	--	--	7J	--	7J	--	--	--	--	--
	4/97	--	--	--	--	--	--	--	3J	--	--	--	--	--
	7/97	--	--	--	--	--	3J	--	2J	--	--	--	--	--
	10/97	--	--	--	--	--	5J	--	3J	--	--	--	--	--
	1/98	--	--	--	--	--	9J	1J	--	--	--	--	--	--
	8/98	--	--	--	--	--	6J	--	--	--	--	1J	--	--
	1/99	--	--	--	--	--	6J	--	--	--	--	--	--	--
	7/99	--	--	--	--	--	--	--	--	--	--	--	--	--
	1/00	--	4J	--	--	--	2J	--	2J	--	1J	--	--	--
	8/00	--	2J	--	--	--	--	--	2J	--	--	--	--	--
	1/01	--	1J	--	--	--	--	--	1J	1J	--	--	--	--
	8/01	--	2BJ	--	--	--	--	--	1J	--	--	--	--	--
	1/02	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/02	2BJ	--	4BJ	3BJ	2J	--	--	--	--	--	--	--	--
	1/03	--	--	--	--	--	2J	--	--	--	--	--	--	--
	7/03	--	--	--	--	--	2J	--	--	--	--	--	--	--
	1/04	--	--	--	--	--	2J	--	--	--	--	--	--	--
	8/04	--	--	--	--	--	3J	--	--	--	--	--	--	--
	1/05	--	--	--	--	--	2J	--	--	--	--	--	--	--
	7/05	--	--	--	--	--	2J	--	--	--	--	--	--	--
	1/06	--	--	--	--	--	--	--	--	--	1J	--	--	--
	8/06	--	--	--	--	--	--	--	--	--	--	--	--	--
	1/07	--	--	--	--	--	--	--	--	--	--	--	--	--
	7/07	--	--	--	--	--	--	--	--	--	--	--	--	--
	1/08	--	--	--	--	--	--	--	--	--	--	--	--	--
	7/08	--	--	--	--	--	1J	--	2J	--	1J	--	--	--
	1/09	--	--	--	--	--	--	--	1.8J	--	--	--	--	--
	7/09	--	--	--	--	--	0.77J	--	1.6J	--	1J	--	--	--
	2/10	--	--	--	--	--	--	--	1.5J	--	1.0J	--	--	--
	8/10	--	--	--	--	--	--	--	3.8J	--	--	--	--	--
	1/11	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/11	--	--	--	--	--	--	--	2.9J	--	--	--	--	--
	1/12	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/12	--	--	--	--	--	--	--	--	--	--	--	--	--
	1/13	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/13	--	--	--	--	--	--	--	2.5J	--	--	--	--	--
	1/14	--	--	--	--	--	--	--	--	--	--	--	--	--
	8/14	--	--	--	--	--	--	--	2.8J	--	--	--	--	--
1/15	--	--	--	--	--	--	--	--	--	--	--	--	--	
7/15	--	--	--	--	--	--	--	--	--	--	--	--	--	
1/16	--	--	--	--	--	--	--	--	--	--	--	--	--	
7/16	--	--	--	--	--	--	--	--	--	--	--	--	--	
1/17	--	--	--	--	--	--	--	--	--	--	--	--	--	
7/17	--	--	--	--	--	0.78J	--	1.4J	--	--	--	--	--	
1/18	--	--	--	--	--	--	--	--	--	--	--	--	--	
8/18	--	--	--	--	--	0.78J	--	2.3J	--	--	--	--	--	
6/19	--	--	--	--	--	--	--	1.2J	--	--	--	--	--	
11/19	--	--	--	--	--	--	--	--	--	--	--	--	--	
6/20	--	--	--	--	--	0.46 J	--	--	--	--	--	--	--	
12/20	--	--	--	--	--	0.70 J	--	--	--	--	--	--	--	
4/21	--	--	--	--	--	0.73 J	--	--	--	--	--	--	--	
11/21	--	--	--	--	--	0.51 J	--	--	--	--	--	--	--	
6/22	--	--	--	--	--	0.76J	--	--	--	--	--	--	--	
12/22	--	--	--	--	--	0.65J	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled	2/92	--	--	--	10	--	--	--	--	--	--	--
MW-05	10/92	--	--	--	--	(12)	--	--	--	--	--	--	--
	6/93	--	--	--	--	--	--	--	--	--	--	--	--
	11/93	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	5/94	--	--	--	--	--	--	--	--	--	--	--	--
	1/95	--	--	--	--	--	--	--	--	--	--	--	--
	6/95	--	--	--	--	--	--	--	--	--	--	--	--
	9/95	--	--	--	--	--	--	--	--	--	--	--	--
	11/95	--	--	--	--	--	--	--	--	--	--	--	--
	3/96	--	--	--	--	--	--	--	--	--	--	--	--
	6/96	--	--	--	--	--	--	--	--	--	--	--	--
	9/96	--	--	--	--	--	--	--	--	--	--	--	--
	12/96	--	--	--	--	--	--	--	--	--	--	--	--
	2/97	--	--	--	--	--	--	--	--	--	--	--	--
	4/97	--	--	--	--	--	--	--	--	--	--	--	--
	7/97	--	--	--	--	--	--	--	--	--	--	--	--
	10/97	--	--	--	4J	--	--	--	--	--	--	--	--
	1/98	--	--	--	--	--	--	--	--	--	--	--	--
	8/98	--	--	--	--	--	--	--	--	--	--	--	--
	1/99	--	--	--	--	--	--	--	--	--	--	--	--
	7/99	--	--	--	--	--	--	--	--	--	--	--	--
	1/00	--	--	--	--	--	--	--	--	--	--	--	--
	8/00	--	--	--	--	--	--	--	--	--	--	--	--
	1/01	--	--	--	--	--	--	--	--	--	--	--	--
	8/01	1BJ	--	--	--	--	--	--	--	--	--	--	--
	1/02	--	--	--	--	--	--	--	--	--	--	--	--
	8/02	1BJ	--	3BJ	2BJ	--	--	--	--	--	--	--	--
	1/03	--	--	--	--	--	--	--	--	--	--	--	--
	7/03	--	--	--	--	--	--	--	--	--	--	--	--
	1/04	--	--	--	--	--	--	--	--	--	--	--	--
	8/04	--	--	--	--	--	--	--	--	--	--	--	--
	1/05	--	--	--	--	--	--	--	--	--	--	--	--
	7/05	--	--	--	--	--	--	--	--	--	--	--	--
	1/06	--	--	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	--	--	--	--	--	--	--	--
	1/07	--	--	--	--	--	--	--	--	--	--	--	--
	7/07	--	--	--	--	--	--	--	--	--	--	--	--
	1/08	--	--	--	--	--	--	--	--	--	--	--	--
	1/09	--	--	--	--	--	--	--	--	--	--	--	--
	7/09	--	--	--	--	--	--	--	--	--	--	--	--
	2/10	--	--	--	--	--	--	--	--	--	--	--	--
	8/10	--	--	--	11	--	--	--	--	--	--	--	--
	1/11	--	--	--	--	--	--	--	--	--	--	--	--
	8/11	--	--	--	--	--	--	--	--	--	--	--	--
	1/12	--	--	--	--	--	--	--	--	--	--	--	--
	8/12	--	--	--	--	--	--	--	--	--	--	--	--
	1/13	--	--	--	--	--	--	--	--	--	--	--	--
	8/13	--	--	--	--	--	--	--	--	--	--	--	--
	1/14	--	--	--	--	--	--	--	--	--	--	--	--
	8/14	--	--	--	--	--	--	--	--	--	--	--	--
	1/15	--	--	--	--	--	--	--	--	--	--	--	--
7/15	--	--	--	--	--	--	--	--	--	--	--	--	
1/16	--	--	--	--	--	--	--	--	--	--	--	--	
7/16	--	--	--	--	--	--	--	--	--	--	--	--	
1/17	--	--	--	--	--	--	--	--	--	--	--	--	
7/17	--	--	--	--	--	--	--	--	--	--	--	--	
1/18	--	--	--	--	--	--	--	--	--	--	--	--	
8/18	--	--	--	3.9J	--	--	--	--	--	--	--	--	
6/19	--	--	--	--	--	--	--	--	--	--	--	--	
11/19	--	--	--	--	--	--	--	--	--	--	--	--	
6/20	--	--	--	--	--	--	--	--	--	--	--	--	
12/20	--	--	--	--	--	--	--	--	--	--	--	--	
4/21	--	--	--	--	--	--	--	--	--	--	--	--	
11/21	--	--	--	3.2 J	--	--	--	--	--	--	--	--	
6/22	--	--	--	--	--	--	--	--	--	--	--	--	
12/22	--	--	--	--	--	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethane	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled	1/95	--	--	--	170	59	--	2 J	--	--	--	--
		6/95	--	--	--	--	54	--	--	--	--	--	--
MW-06A	9/95	--	--	--	--	61	--	1 J	--	--	--	--	--
	11/95	--	--	--	--	43	--	--	--	--	--	--	--
	3/96	--	--	--	--	40	--	--	--	--	--	--	--
	6/96	--	--	--	--	52	--	1 J	--	--	--	--	--
	9/96	--	--	--	--	52	--	--	--	--	--	--	--
	12/96	--	--	--	--	43	--	1J	--	--	--	--	--
	2/97	--	--	2BJ	--	47	--	--	--	--	--	--	--
	4/97	--	--	--	--	29	--	--	--	--	--	--	--
	7/97	--	--	--	--	40	--	1J	--	--	--	--	--
	10/97	--	--	--	--	50	--	1J	--	--	--	--	--
	1/98	--	--	--	--	13	--	--	--	--	--	--	--
	8/98	--	--	--	--	50	--	--	--	--	--	--	--
	1/99	--	--	--	--	51	--	1J	--	--	--	--	--
	7/99	--	--	--	--	42	--	1J	--	--	--	--	--
	1/00	--	4J	--	--	2J	--	2J	--	1J	--	--	--
	8/00	--	--	--	--	38	--	1J	--	--	--	--	--
	1/01	--	--	--	--	40	--	2J	--	--	--	--	--
	8/01	1BJ	--	--	--	40	--	1J	--	--	--	--	--
	1/02	--	--	--	--	43	--	2J	--	--	--	--	--
	8/02	2BJ	--	4BJ	4BJ	13	--	--	--	--	--	--	--
	1/03	--	--	--	--	36	--	--	--	--	--	--	--
	7/03	--	--	--	--	35	--	--	--	--	--	--	--
	1/04	--	--	--	--	--	--	--	--	--	--	--	--
	8/04	--	--	--	--	36	--	--	--	--	--	--	--
	1/05	--	--	--	--	29	--	--	--	--	--	--	--
	7/05	--	--	--	--	30	--	--	--	--	--	--	--
	1/06	--	--	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	27	--	--	--	--	--	--	--
	1/07	--	--	--	--	21	--	--	--	--	--	--	--
	7/07	--	--	--	--	22	--	--	--	--	--	--	--
	1/08	--	--	--	--	15	--	--	--	--	--	--	--
	7/08	--	--	--	--	27	--	1J	--	--	--	--	--
	1/09	--	--	--	--	29	--	--	--	--	--	--	--
	7/09	--	--	--	--	27	--	1J	--	--	--	--	--
	2/10	--	--	--	--	27	--	0.92J	--	--	--	--	--
	8/10	--	--	--	--	25	--	1.4J	--	--	--	--	--
	1/11	--	--	--	--	27	--	--	--	--	--	--	--
	8/11	--	--	--	--	19	--	--	--	--	--	--	--
	1/12	--	--	--	--	11	--	--	--	--	--	--	--
	8/12	--	--	--	--	28	--	--	--	--	--	--	--
	1/13	--	--	--	--	27	--	--	--	--	--	--	--
	8/13	--	--	--	--	22	--	--	--	--	--	--	--
	1/14	--	--	--	--	22	--	--	--	--	--	--	--
	8/14	--	--	--	--	21	--	--	--	--	--	--	--
	1/15	--	--	--	--	27	--	--	--	--	--	--	--
	7/15	--	--	--	--	22	--	--	--	--	--	--	--
	1/16	--	--	--	--	23	--	--	--	--	--	--	--
	7/16	--	--	--	--	23	--	--	--	--	--	--	--
	1/17	--	--	--	--	--	--	--	--	--	--	--	--
	7/17	--	--	--	--	20	--	0.85J	--	--	--	--	--
1/18	--	--	--	--	24	--	0.91J	--	--	--	--	--	
8/18	--	--	--	--	22	--	1.0J	--	--	--	--	--	
6/19	--	--	--	--	--	--	--	--	--	--	--	--	
11/19	--	--	--	--	19	--	--	--	--	--	--	--	
6/20	--	--	--	--	-- F1	--	--	--	--	--	--	--	
12/20	--	--	--	--	19	--	--	--	--	--	--	--	
4/21	--	--	--	--	18	--	--	--	--	--	--	--	
11/21	--	--	--	--	20	--	--	--	--	--	--	--	
6/22	--	--	--	--	18	--	--	--	--	--	--	--	
12/22	--	--	--	--	16	--	--	--	--	--	--	--	
5/23	--	--	--	--	6.9J	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled	1/95	--	--	--	440	--	--	--	--	--	--	--
MW-06DA	6/95	--	--	--	--	95	--	--	--	--	--	--	--
	9/95	--	--	--	--	42	--	--	--	--	--	--	--
	11/95	--	--	--	--	15	--	--	--	--	--	--	--
	3/96	--	--	--	--	20	--	--	--	--	--	--	--
	6/96	--	--	--	--	130	--	--	--	--	--	--	44
	9/96	--	--	--	--	71	--	--	--	--	--	--	--
	12/96	--	--	--	--	30	--	--	--	--	--	--	8
	2/97	--	--	2BJ	--	50	--	--	--	--	--	--	8
	4/97	--	--	--	--	89	--	--	--	--	--	--	--
	7/97	--	--	--	--	52	--	--	--	--	--	--	9
	10/97	--	--	--	--	30	--	--	--	--	--	--	--
	1/98	--	--	--	--	--	--	--	--	--	--	--	--
	8/98	--	--	--	--	38	--	--	--	--	--	--	--
	1/99	--	--	--	--	--	--	--	--	--	--	--	--
	7/99	--	--	--	--	26	--	--	--	--	--	--	--
	1/00	--	--	--	--	19	--	--	--	--	--	--	--
	8/00	--	--	--	--	6J	--	--	--	--	--	--	--
	1/01	--	--	--	--	13	--	--	--	--	--	--	--
	8/01	1BJ	--	--	--	6J	--	--	--	--	--	--	--
	1/02	--	--	--	--	4J	--	--	--	--	--	--	--
	8/02	1BJ	--	--	4BJ	4BJ	--	--	--	--	--	--	--
	1/03	--	--	--	--	--	--	--	--	--	--	--	--
	7/03	--	--	--	--	--	--	--	--	--	--	--	--
	1/04	--	--	--	--	--	--	--	--	--	--	--	--
	8/04	--	--	--	--	--	--	--	--	--	--	--	--
	1/05	--	--	--	--	--	--	--	--	--	--	--	--
	7/05	--	--	--	--	--	--	--	--	--	--	--	--
	1/06	--	--	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	--	--	--	--	--	--	--	--
	1/07	--	--	--	--	--	--	--	--	--	--	--	--
	7/07	--	--	--	--	--	--	--	--	--	--	--	--
	1/08	--	--	--	--	--	--	--	--	--	--	--	--
	7/08	--	--	--	--	--	--	1J	--	--	--	--	--
	1/09	--	--	--	--	--	--	--	--	--	--	--	--
	7/09	--	--	--	--	--	--	--	--	--	--	--	--
	2/10	--	--	--	--	--	--	--	--	--	--	--	--
	8/10	--	--	--	--	--	--	--	--	--	--	--	--
	1/11	--	--	--	--	--	--	--	--	--	--	--	--
	8/11	--	--	--	--	--	--	--	--	--	--	--	--
	1/12	--	--	--	--	--	--	--	--	--	--	--	--
	8/12	--	--	--	--	--	--	--	--	--	--	--	--
	1/13	--	--	--	--	--	--	--	--	--	--	--	--
	8/13	--	--	--	--	--	--	--	--	--	--	--	--
	1/14	--	--	--	3.2 J	--	--	--	--	--	--	--	--
	8/14	--	--	--	--	--	--	--	--	--	--	--	--
	1/15	--	--	--	--	--	--	--	--	--	--	--	--
	7/15	--	--	--	--	--	--	--	--	--	--	--	--
	1/16	--	--	--	--	--	--	--	--	--	--	--	--
	7/16	--	--	--	--	--	--	--	--	--	--	--	--
	1/17	--	--	--	--	--	--	--	--	--	--	--	--
7/17	--	--	--	--	--	--	--	--	--	--	--	--	
1/18	--	--	--	--	--	--	--	--	--	--	--	--	
8/18	--	--	--	--	--	--	--	--	--	--	--	--	
6/19	--	--	--	--	13	--	--	--	--	--	--	--	
11/19	--	--	--	--	--	--	--	--	--	--	--	--	
6/20	--	--	--	--	18	--	0.86 J	--	--	--	--	--	
12/20	--	--	--	--	--	--	--	--	--	--	--	--	
4/21	--	--	--	--	--	--	--	--	--	--	--	--	
11/21	--	--	--	--	--	--	--	--	--	--	--	--	
6/22	--	--	--	--	--	--	--	--	--	--	--	--	
12/22	--	--	--	--	--	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled	--	--	3 BJ	--	--	--	--	--	--	--	--	--
MW-07	10/92	--	--	--	--	--	--	--	--	--	--	--	--
	6/93	--	--	--	--	--	--	--	--	--	--	--	--
	11/93	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	5/94	--	--	--	--	2 J	--	--	--	--	--	--	--
	1/95	--	--	--	--	--	--	--	--	--	--	--	--
	6/95	--	--	--	--	--	--	--	--	--	--	--	--
	9/95	--	--	--	--	--	--	--	--	--	--	--	--
	11/95	--	--	--	--	--	--	--	--	--	--	--	--
	3/96	--	--	--	--	--	--	--	--	--	--	--	--
	6/96	--	--	--	--	--	--	--	--	--	--	--	--
	9/96	--	--	--	--	--	--	--	--	--	--	--	--
	12/96	--	--	--	--	--	--	--	--	--	--	--	--
	2/97	--	--	--	--	--	--	--	--	--	--	--	--
	4/97	--	--	--	--	--	--	--	--	--	--	--	--
	7/97	--	--	--	--	--	--	--	--	--	--	--	--
	10/97	--	--	--	--	--	--	--	--	--	--	--	--
	1/98	--	--	--	--	--	--	--	--	--	--	--	--
	8/98	2BJ	--	--	--	--	--	--	--	--	--	--	--
	1/99	--	--	--	--	--	--	--	--	--	--	--	--
	7/99	--	--	--	--	--	--	--	--	--	--	--	--
	1/00	--	--	--	--	--	--	--	--	--	--	--	--
	8/00	--	--	--	--	--	--	--	--	--	--	--	--
	1/01	--	--	--	--	--	--	--	--	--	--	--	--
	8/01	1BJ	--	--	--	--	--	--	--	--	--	--	--
	1/02	--	--	--	1J	--	--	--	--	--	--	--	--
	8/02	--	--	5BJ	2BJ	--	--	--	--	--	--	--	--
	1/03	--	--	--	--	--	--	--	--	--	--	--	--
	7/03	--	--	--	--	--	--	--	--	--	--	--	--
	1/04	--	--	--	--	--	--	--	--	--	--	--	--
	8/04	--	--	--	--	--	--	--	--	--	--	--	--
	1/05	--	--	--	--	--	--	--	--	--	--	--	--
	7/05	--	--	--	--	--	--	--	--	--	--	--	--
	1/06	--	--	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	--	--	--	--	--	--	--	--
	1/07	--	--	--	--	--	--	--	--	--	--	--	--
	7/07	--	--	--	--	--	--	--	--	--	--	--	--
	1/08	--	--	--	--	--	--	--	--	--	--	--	--
	7/08	--	--	--	--	--	--	--	--	--	--	--	--
	1/09	--	--	--	--	--	--	--	--	--	--	--	--
	7/09	--	--	--	--	--	--	--	--	--	--	--	--
	2/10	--	--	--	--	--	--	--	--	--	--	--	--
	8/10	--	--	--	--	--	--	--	--	--	--	--	--
	1/11	--	--	--	--	--	--	--	--	--	--	--	--
	8/11	--	--	--	--	--	--	--	--	--	--	--	--
	1/12	--	--	--	--	--	--	--	--	--	--	--	--
	8/12	--	--	--	--	--	--	--	--	--	--	--	--
	1/13	--	--	--	3.1J	--	--	--	--	--	--	--	1.5J
	8/13	--	--	--	--	--	--	--	--	--	--	--	--
	1/14	--	--	--	--	--	--	--	--	--	--	--	--
	8/14	--	--	--	--	--	--	--	--	--	--	--	--
1/15	--	--	--	--	--	--	--	--	--	--	--	--	
7/15	--	--	--	--	--	--	--	--	--	--	--	--	
1/16	--	--	--	--	--	--	--	--	--	--	--	--	
7/16	--	--	--	--	--	--	--	--	--	--	--	--	
1/17	--	--	--	--	--	--	--	--	--	--	--	--	
7/17	--	--	--	--	--	--	--	--	--	--	--	--	
1/18	--	--	--	--	--	--	--	--	--	--	--	--	
8/18	--	--	--	4.3J	--	--	--	--	--	--	--	--	
6/19	--	--	--	--	--	--	--	--	--	--	--	--	
11/19	--	--	--	--	--	--	--	--	--	--	--	--	
6/20	--	--	--	--	--	--	--	--	--	--	--	--	
12/20	--	--	--	--	--	--	--	--	--	--	--	--	
4/21	--	--	--	--	--	--	--	--	--	--	--	--	
11/21	--	--	--	--	--	--	--	--	--	--	--	--	
6/22	--	--	--	--	--	--	--	--	--	--	--	--	
12/22	--	--	--	--	--	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethane	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled	2/92	--	--	--	--	89	14	11	--	--	--	--
MW-09	10/92	--	--	--	--	--	92	11	3 J	--	--	--	--
	6/93	--	--	--	--	--	78	10	3 J	--	--	--	--
	11/93	--	--	--	--	--	87 B	8	--	--	--	--	--
	5/94	--	--	--	--	--	93	6	8	--	--	--	--
	1/95	--	--	--	--	--	61	4 J	22	--	--	--	--
	6/95	--	--	--	--	--	13,000	5 J	15	--	--	--	--
	9/95	--	--	--	--	--	4,100	--	--	--	--	--	--
	11/95	42 J	--	--	--	--	2,900	--	--	--	--	--	--
	3/96	--	--	--	--	--	550	9 J	29	--	--	--	--
	6/96	--	--	--	--	--	600	4 J	30	--	--	--	--
	9/96	--	--	--	--	--	350	--	9J	--	--	--	--
	12/96	--	--	--	--	--	190D	3J	5J	--	--	--	--
	2/97	--	--	--	--	--	190	2J	5J	--	--	--	--
	4/97	--	--	--	--	--	150	2J	2J	--	--	--	--
	7/97	--	--	--	--	--	370	2J	4J	--	--	--	--
	10/97	--	--	--	--	--	120	3J	4J	2J	3J	--	--
	1/98	--	--	--	--	--	170	--	2J	--	--	--	--
	8/98	1BJ	--	--	--	--	83	2J	4J	--	--	--	--
	1/99	--	--	--	--	--	32	1J	--	5J	6J	--	--
	7/99	--	--	--	--	--	20	--	6J	6J	1J	--	--
	1/00	--	--	--	--	--	34	--	5J	6J	2J	--	--
	8/00	--	--	--	--	--	32	1J	3J	--	--	--	--
	1/01	--	--	--	--	--	33	--	5J	2J	--	--	--
	8/01	1BJ	--	--	--	--	23	1J	5J	5J	2J	--	--
	1/02	--	--	--	--	--	20	--	4J	7J	1J	--	--
	8/02	2BJ	--	4BJ	3BJ	--	18	--	6J	4J	3J	--	--
	1/03	--	--	--	--	--	20	--	--	4J	--	--	--
	7/03	--	--	--	--	--	12	--	5J	4J	3J	--	--
	1/04	--	--	--	--	--	25	--	--	2J	--	--	--
	8/04	--	--	--	--	--	11	--	--	4J	--	--	--
	1/05	--	--	--	--	--	17	--	--	2J	--	--	--
	7/05	--	--	--	--	--	7J	--	--	6J	4J	--	--
	1/06	--	--	--	--	--	18	--	--	3J	--	--	--
	8/06	--	--	--	--	--	14	--	3J	3J	--	--	--
	1/07	--	--	--	--	--	20	--	2J	1J	--	--	--
	7/07	--	--	--	--	--	9J	--	3J	4J	4J	--	--
	1/08	--	--	--	--	--	20	--	2J	--	--	--	--
	7/08	--	--	--	--	--	9J	--	3J	2J	1J	--	--
	1/09	--	--	--	--	--	15	--	2.0J	1.1J	--	--	--
	7/09	--	--	--	--	--	12	--	2.0J	0.87J	--	--	--
	2/10	--	--	--	--	--	12	--	1.4J	1.3J	--	--	--
	8/10	--	--	--	--	--	9.1J	--	2.1J	2.0J	--	--	--
	1/11	--	--	--	--	--	8.4J	--	--	1.7J	--	--	--
	8/11	--	--	--	--	--	9.0J	--	3.2J	2.1J	3.0J	--	--
	1/12	--	--	--	--	--	16	--	--	--	--	--	--
	8/12	--	--	--	--	--	8.3J	--	3.6J	--	--	--	--
	1/13	--	--	--	--	--	9.7J	--	--	--	--	--	--
	8/13	--	--	--	--	--	10	--	--	--	--	--	--
	1/14	--	--	--	--	--	11	--	--	--	--	--	--
	8/14	--	--	--	--	--	9.4J	--	2.2J	--	--	--	--
1/15	--	--	--	--	--	7.5J	--	2.5J	--	--	--	--	
7/15	--	--	--	--	--	9.4J	--	--	--	--	--	--	
1/16	--	--	--	--	--	7.0J	--	--	--	--	--	--	
7/16	--	--	--	--	--	7.5J	--	4.4J	--	--	--	--	
1/17	--	--	--	--	--	12	--	--	--	--	--	--	
7/17	--	--	--	--	--	7.4J	--	--	--	--	--	--	
1/18	--	--	--	--	--	8.3J	--	--	--	--	--	--	
8/18	--	--	--	--	3.5J	7.3J	--	2.1J	0.54J	--	--	--	
6/19	--	--	--	--	--	8.0J	--	--	--	--	--	--	
11/19	--	--	--	--	--	5.9J	--	--	--	--	--	--	
6/20	--	--	--	--	--	6.3J	--	--	--	--	--	--	
12/20	--	--	--	--	--	5.8J	--	1.4 J	--	--	--	--	
4/21	--	--	--	--	--	6.3J	--	--	--	--	--	--	
11/21	--	--	--	--	--	6.3J	--	1.0 J	--	--	--	--	
6/22	--	--	--	--	--	6.5J	--	0.83J	--	--	--	--	
12/22	--	--	--	--	--	5.9J	--	--	0.56J	--	--	--	
5/23	--	--	--	--	--	4.9J	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

Well Number	Date Sampled	Parameters ug/L									
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethane	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene
MW-09D	2/92	--	--	--	--	3J	--	--	--	--	--
	6/93	--	--	--	--	--	--	--	--	--	--
	11/93	--	--	--	--	4 BJ	--	--	--	--	--
	5/94	--	--	--	--	2J	--	--	--	--	--
	1/95	--	--	--	--	--	--	--	--	--	--
	6/95	--	--	--	--	2BJ	--	--	--	--	--
	9/95	--	--	--	--	--	--	--	--	--	--
	11/95	--	--	--	--	--	--	--	--	--	--
	3/96	--	--	--	--	--	--	--	--	--	--
	6/96	--	--	--	--	4 J	--	--	--	--	--
	9/96	--	--	--	--	--	--	--	--	--	--
	12/96	--	--	--	--	--	--	--	--	--	--
	2/97	--	--	2BJ	--	--	--	--	--	--	--
	4/97	--	--	--	--	--	--	--	--	--	--
	7/97	--	--	--	--	--	--	--	--	--	--
	10/97	--	--	--	--	--	--	--	--	--	--
	1/98	--	--	--	--	--	--	--	--	--	--
	8/98	--	--	--	--	--	--	--	--	--	--
	1/99	--	--	--	--	--	--	--	--	--	--
	7/99	--	--	--	--	--	--	--	--	--	--
	1/00	--	--	--	--	--	--	--	--	--	--
	8/00	--	--	--	--	--	--	--	--	--	--
	1/01	--	--	--	2J	--	--	--	--	--	--
	8/01	1BJ	--	--	2J	--	--	--	--	--	--
	1/02	--	--	--	--	--	--	--	--	--	--
	8/02	1BJ	--	3BJ	--	--	--	--	--	--	--
	1/03	--	--	--	--	--	--	--	--	--	--
	7/03	--	--	--	--	--	--	--	--	--	--
	1/04	--	--	--	--	--	--	--	--	--	--
	8/04	--	--	--	--	--	--	--	--	--	--
	1/05	--	--	--	--	--	--	--	--	--	--
	7/05	--	--	--	--	--	--	--	--	--	--
	1/06	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	--	--	--	--	--	--
	1/07	--	--	--	--	--	--	--	--	--	--
	7/07	--	--	--	--	--	--	--	--	--	--
	1/08	--	--	--	--	--	--	--	--	--	--
	7/08	--	--	--	--	--	--	--	--	--	--
	1/09	--	--	--	--	--	--	--	--	--	--
	7/09	--	--	--	--	--	--	--	--	--	--
	2/10	--	--	--	--	--	--	--	--	--	--
	8/10	--	--	--	--	--	--	--	--	--	--
	1/11	--	--	--	--	--	--	--	--	--	--
	8/11	--	--	--	--	--	--	--	--	--	--
	1/12	--	--	--	--	--	--	--	--	--	--
	8/12	--	--	--	--	--	--	--	--	--	--
	1/13	--	--	--	--	--	--	--	--	--	--
	8/13	--	--	--	--	--	--	--	--	--	--
	1/14	--	--	--	--	--	--	--	--	--	--
	8/14	--	--	--	--	--	--	--	--	--	--
	1/15	--	--	--	--	--	--	--	--	--	--
	7/15	--	--	--	--	--	--	--	--	--	--
	1/16	--	--	--	--	--	--	--	--	--	--
	7/16	--	--	--	--	--	--	--	--	--	--
	1/17	--	--	--	--	--	--	--	--	--	--
	7/17	--	--	--	--	--	--	--	--	--	--
	1/18	--	--	--	--	--	--	--	--	--	--
	8/18	--	--	--	--	--	--	--	--	--	--
	6/19	--	--	--	--	--	--	--	--	--	--
	11/19	--	--	--	--	--	--	--	--	--	--
	6/20	--	--	--	--	--	--	--	--	--	--
	12/20	--	--	--	--	--	--	--	--	--	--
	4/21	--	--	--	--	--	--	--	--	--	--
	11/21	--	--	--	--	--	--	--	--	--	--
	6/22	--	--	--	--	--	--	--	--	--	--
	12/22	--	--	--	--	--	--	--	--	--	--

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled												
MW-11	6/93	--	--	--	--	--	--	--	--	--	--	--	--
	11/93	--	--	--	--	--	--	--	--	--	--	--	--
	5/94	--	--	--	--	--	--	--	--	--	--	--	--
	1/95	--	--	--	--	--	--	--	--	--	--	--	--
	6/95	--	--	--	--	--	--	--	--	--	--	--	--
	9/95	--	--	--	--	--	--	--	--	--	--	--	--
	11/95	--	--	--	--	--	--	--	--	--	--	--	--
	3/96	--	--	--	--	--	--	--	--	--	--	--	--
	6/96	--	--	--	--	--	--	--	--	--	--	--	--
	9/96	--	--	--	--	--	--	--	--	--	--	--	--
	12/96	--	--	--	--	--	--	--	--	--	--	--	--
	2/97	--	--	--	--	--	--	--	--	--	--	--	--
	4/97	--	--	--	--	--	--	--	--	--	--	--	--
	7/97	--	--	--	--	--	--	--	--	--	--	--	--
	10/97	--	--	--	--	--	--	--	--	--	--	--	--
	1/98	--	--	--	--	--	--	--	--	--	--	--	--
	8/98	--	--	--	--	--	--	--	--	--	--	--	--
	1/99	--	30	--	--	--	--	--	--	--	--	--	--
	7/99	2J	10	--	--	--	--	--	--	--	--	--	--
	1/00	--	--	--	--	--	--	--	--	--	--	--	--
	8/00	--	--	--	--	--	--	--	--	--	--	--	--
	1/01	--	--	--	--	--	--	--	--	--	--	--	--
	8/01	1BJ	--	--	--	--	--	--	--	--	--	--	--
	1/02	--	--	--	--	37	2J	--	--	--	--	--	--
	8/02	2BJ	--	3BJ	2BJ	--	--	--	--	--	--	--	--
	1/03	--	--	--	--	--	--	--	--	--	--	--	--
	7/03	--	--	--	--	--	--	--	--	--	--	--	--
	1/04	--	--	--	--	--	--	--	--	--	--	--	--
	8/04	--	--	--	--	--	--	--	--	--	--	--	--
	1/05	--	--	--	--	--	--	--	--	--	--	--	--
	7/05	--	--	--	--	--	--	--	--	--	--	--	--
	1/06	--	--	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	--	--	--	--	--	--	--	--
	1/07	--	--	--	--	--	--	--	--	--	--	--	--
	7/07	--	--	--	--	--	--	--	--	--	--	--	--
	1/08	--	--	--	--	--	--	--	--	--	--	--	--
	7/08	--	--	--	--	--	--	--	--	--	--	--	--
	1/09	--	--	--	--	--	--	--	--	--	--	--	--
	7/09	--	--	--	--	--	--	--	--	--	--	--	--
	2/10	--	--	--	--	--	--	--	--	--	--	--	--
	8/10	--	--	--	--	--	--	--	--	--	--	--	--
	1/11	--	--	--	--	--	--	--	--	--	--	--	--
8/11	--	--	--	--	--	--	--	--	--	--	--	--	
1/12	--	--	--	--	--	--	--	--	--	--	--	--	
8/12	--	--	--	--	--	--	--	--	--	--	--	--	
1/13	--	--	--	--	--	--	--	--	--	--	--	--	
8/13	--	--	--	--	--	--	--	--	--	--	--	--	
1/14	--	--	--	--	--	--	--	--	--	--	--	--	
8/14	--	--	--	--	--	--	--	--	--	--	--	--	
1/15	--	--	--	--	--	--	--	--	--	--	--	--	
7/15	--	--	--	--	--	--	--	--	--	--	--	--	
1/16	--	--	--	--	--	--	--	--	--	--	--	--	
7/16	--	--	--	--	--	--	--	--	--	--	--	--	
1/17	--	--	--	--	--	--	--	--	--	--	--	--	
7/17	--	--	--	--	--	--	--	--	--	--	--	--	
1/18	--	--	--	--	--	--	--	--	--	--	--	--	
8/18	--	--	--	--	--	--	--	--	--	--	--	--	
6/19	--	--	--	--	--	--	--	--	--	--	--	--	
11/19	--	--	--	--	--	--	--	--	--	--	--	--	
6/20	--	--	--	--	--	--	--	--	--	--	--	--	
12/20	--	--	--	--	--	--	--	--	--	--	--	--	
4/21	--	--	--	--	--	--	--	--	--	--	--	--	
11/21	--	--	--	--	--	--	--	--	--	--	--	--	
6/22	--	--	--	--	--	--	--	--	--	--	--	--	
12/22	--	--	--	--	--	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled	9/96	--	--	--	--	300D	10	--	--	--	--	--
		12/96	--	--	--	--	300D	11	1J	--	--	--	--
		2/97	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
		4/97	--	--	--	--	180D	6J	--	--	--	--	--
		7/97	--	--	--	--	190	7J	--	--	--	--	--
		10/97	--	--	--	--	230D	8J	--	--	--	--	--
		1/98	--	--	--	--	270	5J	--	--	--	--	--
		8/98	--	--	--	--	180	6J	--	--	--	--	--
		1/99	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
		7/99	--	--	--	--	130	5J	--	--	--	--	--
		1/00	--	--	--	--	230E	8J	7J	4J	2J	--	--
		8/00	--	--	--	--	120	4J	1J	--	--	--	--
		8/01	1BJ	--	--	--	78	5J	--	--	--	--	--
		1/02	--	--	--	--	55	3J	2J	1J	--	--	--
		8/02	--	--	4BJ	--	59	4J	--	--	--	--	--
		1/03	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
		7/03	--	--	--	--	56	3J	--	--	--	--	--
		1/04	--	--	--	--	79	3J	--	2J	--	--	--
		8/04	--	--	--	--	14	2J	--	--	--	--	--
		1/05	--	--	--	--	48	2J	--	--	--	--	--
		7/05	--	--	--	--	42	3J	--	--	--	--	--
		1/06	--	--	--	--	50	2J	--	2J	--	--	--
		8/06	--	--	--	--	40	3J	--	--	--	--	--
		1/07	--	--	--	--	37	2J	2J	1J	--	--	--
		7/07	--	--	--	--	31	2J	--	--	--	--	--
		1/08	--	--	--	--	37	--	4J	--	--	--	--
		7/08	--	--	--	--	31	2J	--	--	--	--	--
		1/09	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
		3/09	--	--	--	--	26	1.5 J	1.1 J	0.54 J	--	--	--
		7/09	--	--	--	--	29	1.7J	--	--	--	--	--
		4/10	--	--	--	--	24	--	1.1J	--	--	--	--
		8/10	--	--	--	--	26	--	--	--	--	--	--
		1/11	--	--	--	--	24	--	--	--	--	--	--
		8/11	--	--	--	--	25	--	--	--	--	--	--
		1/12	--	--	--	--	23	--	1.9J	--	--	--	--
		8/12	--	--	--	--	26	--	--	--	--	--	--
		1/13	--	--	--	--	22	--	2.1J	--	--	--	--
		8/13	--	--	--	--	20	--	--	--	--	--	--
		1/14	--	--	--	--	19	--	--	--	--	--	--
		8/14	--	--	--	--	18	--	--	--	--	--	--
		1/15	--	--	--	--	19	--	--	--	--	--	--
		7/15	--	--	--	--	16	--	--	--	--	--	--
		1/16	--	--	--	--	17	--	--	--	--	--	--
		7/16	--	--	--	--	17	--	--	--	--	--	--
		1/17	--	--	--	--	17	--	--	--	--	--	--
		7/17	--	--	--	--	15	1.0J	--	--	--	--	--
		1/18	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
		8/18	--	--	--	--	16	1.1J	--	--	--	--	--
		6/19	--	--	--	--	11	--	--	--	--	--	--
		11/19	--	--	--	--	14	1.1 J	--	--	--	--	--
		6/20	--	--	--	--	10	--	--	--	--	--	--
		12/20	--	--	--	--	15	--	--	--	--	--	--
		4/21	--	--	--	--	11	--	--	--	--	--	--
		11/21	--	--	--	--	15	1.2 J	--	--	--	--	--
		6/22	--	--	--	--	10	--	--	--	--	--	--
		12/22	--	--	--	--	14	1.1 J	--	--	--	--	--
		5/23	--	--	--	--	7.5 J	--	--	--	--	--	--

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled												
MW-13	9/96	--	--	--	--	28	9J	1J	--	--	--	--	--
	12/96	--	--	--	--	15	7J	1J	--	--	--	--	--
	2/97	--	--	--	--	15	5J	--	--	--	--	--	--
	4/97	--	--	--	--	11	4J	--	--	--	--	--	--
	7/97	--	--	--	--	7J	3J	--	--	--	--	--	--
	10/97	--	--	--	--	10	4J	--	--	--	--	--	--
	1/98	--	--	--	--	5J	2J	--	--	--	--	--	--
	8/98	--	--	--	--	3J	3J	--	--	--	--	--	--
	1/99	--	--	--	--	16	4J	--	--	--	--	--	--
	7/99	--	--	--	--	9J	3J	--	--	--	--	--	--
	1/00	--	--	--	--	18	3J	--	--	--	--	--	--
	8/00	--	--	--	--	24	2J	--	--	--	--	--	--
	1/01	--	--	--	--	18	2J	--	--	--	--	--	--
	8/01	1BJ	--	--	--	20	2J	--	--	--	--	--	--
	1/02	--	--	--	--	14	2J	--	1J	--	--	--	--
	8/02	1BJ	--	4BJ	3BJ	19	2J	--	--	--	--	--	--
	1/03	--	--	--	--	12	1J	--	--	--	--	--	--
	7/03	--	--	--	--	15	2J	--	--	--	--	--	--
	1/04	--	--	--	--	11	--	--	--	--	--	--	--
	8/04	--	--	--	--	55	4J	--	--	--	--	--	--
	1/05	--	--	--	--	8J	--	--	--	--	--	--	--
	7/05	--	--	--	--	11	2J	--	--	--	--	--	--
	1/06	--	--	--	--	9J	1J	--	--	--	--	--	--
	8/06	--	--	--	--	10	1J	--	--	--	--	--	--
	1/07	--	--	--	--	6J	--	--	--	--	--	--	--
	7/07	--	--	--	--	7J	1J	--	--	--	--	--	--
	1/08	--	--	--	--	5J	--	--	--	--	--	--	--
	7/08	--	--	--	--	7J	1J	--	--	--	--	--	--
	1/09	--	--	--	--	4.1J	--	--	--	--	--	--	--
	7/09	--	--	--	--	4.9J	0.81J	--	--	--	--	--	--
	2/10	--	--	--	--	2.9J	--	--	--	--	--	--	--
	8/10	--	--	--	--	4.3J	--	--	--	--	--	--	--
	1/11	--	--	--	--	2.8J	--	--	--	--	--	--	--
	8/11	--	--	--	--	4.2J	--	--	--	--	--	--	--
	1/12	--	--	--	--	2.3J	--	--	--	--	--	--	--
	8/12	--	--	--	--	3.2J	--	--	--	--	--	--	--
	1/13	--	--	--	--	2.2J	--	--	--	--	--	--	--
	8/13	--	--	--	--	2.8J	--	--	--	--	--	--	--
	1/14	--	--	--	--	--	--	--	--	--	--	--	--
	8/14	--	--	--	--	2.0J	--	--	--	--	--	--	--
1/15	--	--	--	--	--	--	--	--	--	--	--	--	
7/15	--	--	--	--	--	--	--	--	--	--	--	--	
1/16	--	--	--	--	--	--	--	--	--	--	--	--	
7/16	--	--	--	--	--	--	--	--	--	--	--	--	
1/17	--	--	--	--	--	--	--	--	--	--	--	--	
7/17	--	--	--	--	1.6J	--	--	--	--	--	--	--	
1/18	--	--	--	--	1.0J	--	--	--	--	--	--	--	
8/18	--	--	--	--	1.4J	--	--	--	--	--	--	--	
6/19	--	--	--	--	1.0J	--	--	--	--	--	--	--	
11/19	--	--	--	--	0.82 J	--	--	--	--	--	--	--	
6/20	--	--	--	--	1.2 J	--	--	--	--	--	--	--	
12/20	--	--	--	--	1.2 J	--	--	--	--	--	--	--	
4/21	--	--	--	--	1.1 J	--	--	--	--	--	--	--	
11/21	--	--	--	--	1.3 J	--	--	--	--	--	--	--	
6/22	--	--	--	--	1.0J	--	--	--	--	--	--	--	
12/22	--	--	--	--	1.2 J	--	--	--	--	--	--	--	

Table 1. Summary of Volatile Organic Compounds Concentrations in Groundwater - Arcade, New York

		Parameters ug/L											
		Toluene	Benzene	Methylene Chloride	Acetone	Trichloroethylene	1,1,1-Trichloroethane	1,2-Dichloroethene	1,1-Dichloroethane	Vinyl Chloride	Ethylbenzene	Total Xylenes	2-Butanone
Well Number	Date Sampled												
MW-14	8/00	--	--	--	--	--	--	--	--	--	--	--	--
	1/01	--	--	--	--	--	--	--	--	--	--	--	--
	8/01	1BJ	--	--	--	--	--	--	--	--	--	--	--
	1/02	--	--	--	--	--	--	--	--	--	--	--	--
	8/02	1BJ	--	5BJ	4BJ	--	--	--	--	--	--	--	--
	1/03	--	--	--	--	--	--	--	--	--	--	--	--
	7/03	--	--	--	--	--	--	--	--	--	--	--	--
	1/04	--	--	--	--	--	--	--	--	--	--	--	--
	8/04	--	--	--	--	--	--	--	--	--	--	--	--
	1/05	--	--	--	--	--	--	--	--	--	--	--	--
	7/05	--	--	--	--	--	--	--	--	--	--	--	--
	1/06	--	--	--	--	--	--	--	--	--	--	--	--
	8/06	--	--	--	--	--	--	--	--	--	--	--	--
	1/07	--	--	--	--	--	--	--	--	--	--	--	--
	7/07	--	--	--	--	--	--	--	--	--	--	--	--
	1/08	--	--	--	--	--	--	--	--	--	--	--	--
	7/08	--	--	--	--	--	--	--	--	--	--	--	--
	1/09	--	--	--	--	--	--	--	--	--	--	--	--
	7/09	--	--	--	--	--	--	--	--	--	--	--	--
	2/10	--	--	--	--	--	--	--	--	--	--	--	--
	8/10	--	--	--	--	--	--	--	--	--	--	--	--
	1/11	--	--	--	--	--	--	--	--	--	--	--	--
	8/11	--	--	--	--	--	--	--	--	--	--	--	--
	1/12	--	--	--	--	--	--	--	--	--	--	--	--
	8/12	--	--	--	--	--	--	--	--	--	--	--	--
	1/13	--	--	--	--	--	--	--	--	--	--	--	--
	8/13	--	--	--	--	--	--	--	--	--	--	--	--
	1/14	--	--	--	--	--	--	--	--	--	--	--	--
	8/14	--	--	--	--	--	--	--	--	--	--	--	--
	1/15	--	--	--	--	--	--	--	--	--	--	--	--
	7/15	--	--	--	--	--	--	--	--	--	--	--	--
	1/16	--	--	--	--	--	--	--	--	--	--	--	--
	7/16	--	--	--	--	--	--	--	--	--	--	--	--
1/17	--	--	--	--	--	--	--	--	--	--	--	--	
7/17	--	--	--	--	--	--	--	--	--	--	--	--	
1/18	--F1	--F1	--F1	--	--F1	--F1	--F1	--F1	--F1	--	--	--	
8/18	--	--	--	--	--	--	--	--	--	--	--	--	
6/19	--	--	--	--	--	--	--	--	--	--	--	--	
11/19	--	--	--	--	--	--	--	--	--	--	--	--	
6/20	--	--	--	--	--	--	--	--	--	--	--	--	
12/20	--	--	--	--	--	--	--	--	--	--	--	--	
4/21	--	--	--	--	--	--	--	--	--	--	--	--	
11/21	--	--	--	--	--	--	--	--	--	--	--	--	
6/22	--	--	--	--	--	--	--	--	--	--	--	--	
12/22	--	--	--	--	--	--	--	--	--	--	--	--	

NOTES: -- Not Detected
 B Compound was also detected in the associated method blank.
 D Analysis performed at a secondary dilution factor.
 Dup Duplicate Sample
 E Compound was detected above the instruments calibration range thus a secondary dilution was performed.
 J Detected below method detection limit. Value shown is therefore estimated.
 F1 MS or MSD recovery outside of acceptance limits.
 NS No Sample
 (3) Values in parentheses are less than 10 times that found in the field blank or Laboratory method blanks and therefore are not representative of actual site conditions (i.e., artifacts or attributable to laboratory introduced contamination).*
 * Reference: U.S. EPA, 1988. Laboratory Data Validation Functional Guidelines for Evaluating Organics Analyses.
 MW-09 Groundwater well sample (water table)
 MW-09D Groundwater well sample (deep)

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-01 (Relocated 12/99)	10/92	--	0.353	0.442	--	--	--
	6/93	--	0.2	0.25	--	--	--
	11/93	--	NA	NA	--	NA	NA
	5/94	--	0.022	--	--	--	--
	1/95	5*	163	0.205 E	--	--	--
	6/95	0.084	0.161	0.26	--	--	3.0 E
	9/95	--	--	0.0192 SN	--	--	--
	11/95	--	0.0836	0.12	--	--	--
	3/96	--	--	--	0.00065 B	--	--
	6/96	--	--	0.0014 B	--	--	--
	9/96	--	--	0.00098 B	--	--	0.0010 B
	12/96	--	0.041	0.059	--	--	--
	2/97	--	0.0030B	0.0027B	0.00089B	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	--	0.0012B	--	--	--	--
	1/98	--	0.0013B	--	0.0028B	--	--
	8/98	0.0132	0.0146	0.0197	--	--	--
	1/99	0.0018	0.0033	0.0026	0.0007	--	--
	7/99	--	--	0.0037	0.001	--	--
	12/99	--	0.032	0.066	--	--	0.013
	1/00	--	0.02	0.0104	--	0.0025	--
	8/00	--	0.0184	0.0116	0.0012B	--	--
	1/01	--	0.0524	0.0444	--	--	--
	8/01	0.005	0.283	0.276	--	--	--
	1/02	--	0.0607	0.0332	--	--	--
	8/02	--	0.0326	0.0288	--	--	--
	1/03	--	0.0624	0.0561	--	--	--
	7/03	--	0.0787	0.0673	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	0.0215	0.0158	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	0.0344	0.0256	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	0.0055	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0039	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	0.0105	0.0105	--	--	--
	6/19	--	0.0144	0.0103	--	--	--
	11/19	--	--	0.0045	--	--	--
	6/20	--	0.0901	--	--	--	--
	12/20	--	--	--	--	--	--
	12/21	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	0.0068	--	--	--
	6/22	--	--	--	--	--	--
	12/22	--	--	0.0031	--	--	--
	5/23	--	--	--	--	--	--

Notes at end of table

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-1DA	1/95	0.51	3.09	0.68	--	--	2 BW
	6/95	1.61	1.54	0.29	--	--	--
	9/95	--	0.211	0.141 SN	--	--	--
	11/95	--	0.189	0.0419	--	--	--
	3/96	--	--	--	--	--	--
	6/96	0.0011B	0.0144	0.0063	0.00047 B	--	--
	9/96	0.00023B	0.0119	0.0016B	--	--	0.0016 B
	12/96	--	0.0095B	0.0034	--	--	--
	2/97	--	--	--	0.00069B	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	--	--	--	--	--	--
	1/98	--	0.0015B	--	0.0016B	--	--
	8/98	0.0008	0.0014	--	--	--	--
	1/99	--	0.0015	--	--	0.0021	0.003
	7/99	--	--	--	--	--	--
	12/99	--	0.016	0.015	--	0.0021	0.012
	1/00	--	0.0057	0.003	--	--	--
	8/00	--	0.0429	0.0182	--	--	--
	1/01	--	0.0326	0.0275	--	--	--
	8/01	--	--	0.0034	--	--	--
	1/02	--	--	--	--	--	--
	8/02	--	--	--	--	--	--
	1/03	--	--	--	--	--	--
	7/03	--	--	--	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	0.00365	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	0.0032	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0031	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	--	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	0.0044	--	--	--
	6/20	--	--	--	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--
	12/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-02A	1/95	7.9 *	191	0.295 E	--	--	--
	6/95	0.045	0.059	0.28	--	--	--
	9/95	NS	NS	NS	NS	NS	NS
	11/95	--	0.0454	0.148	--	--	--
	3/96	0.006	0.0368	0.127	--	--	--
	6/96	--	0.0237	0.0935	--	--	--
	9/96	NS	NS	NS	NS	NS	NS
	12/96	--	0.033	0.151	--	--	--
	2/97	0.0128	0.0201	0.0538	0.00078B	--	--
	4/97	--	--	0.0353	--	--	--
	7/97	NS	NS	NS	NS	NS	NS
	10/97	0.0046B	0.0141	0.0606	--	--	--
	1/98	0.0032B	0.03	0.136	--	--	--
	8/98	0.0357	0.0161	0.0955	--	--	--
	1/99	NS	NS	NS	NS	NS	NS
	7/99	NS	NS	NS	NS	NS	NS
	1/00	--	--	0.0032	--	--	--
	1/01	--	--	0.0044	--	--	--
	1/02	--	0.033	--	--	--	--
	1/03	--	--	0.0042	--	--	--
	1/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	0.02460	--	0.01330	--	--	--
	1/09	0.08240	--	0.00481	--	--	--
	7/09	0.60000	0.01590	0.09860	--	--	--
	2/10	0.00550	--	--	--	--	--
	8/10	0.21200	--	0.02940	0.00540	--	0.00300
	1/11	0.14300	--	0.01420	--	--	--
	8/11	NS	NS	NS	NS	NS	NS
	1/12	0.00600	--	--	--	--	--
	8/12	NS	NS	NS	NS	NS	NS
	1/13	0.01590	--	--	--	--	--
	8/13	NS	NS	NS	NS	NS	NS
	1/14	0.0109	--	--	--	--	--
	8/14	0.454	0.0144	0.0323	0.0331	--	--
	1/15	0.463	0.0157	0.0423	--	--	--
	7/15	0.179	--	0.0105	--	--	--
	1/16	0.0228	--	0.0073	--	--	--
	7/16	NS	NS	NS	NS	NS	NS
	1/17	--	--	--	--	--	--
	7/17	0.0237	--	--	0.0084	--	--
	1/18	0.075	--	0.0044	0.0138	--	--
	8/18	NS	NS	NS	NS	NS	NS
	6/19	0.0138	--	--	--	--	--
	11/19	0.0204	--	--	0.0051	--	--
	6/20	--	--	--	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--
	12/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-03	10/92	--	0.254	0.307	--	--	--
	6/93	--	0.26	0.36	--	--	--
	11/93	--	NA	NA	--	NA	NA
	5/94	0.052	0.013	--	--	--	--
	1/95	0.151 *	0.168	0.193 E	--	--	2.1 B
	6/95	0.068	0.121	0.16	--	--	--
	9/95	0.0055	--	--	--	--	--
	11/95	--	0.0276	0.0382	--	--	--
	3/96	0.00063 B	--	--	0.00063 B	--	--
	6/96	--	0.0028 B	0.0031	0.0006 B	--	--
	9/96	--	0.0026 B	0.0014 B	--	--	--
	12/96	--	0.042	0.057	--	--	--
	2/97	0.00070B	--	--	--	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	0.0037	--	--	--
	10/97	--	0.0013B	--	--	--	--
	1/98	--	0.0022B	0.0023B	--	--	--
	8/98	0.0007	--	--	--	--	--
	1/99	0.0031	0.0056	0.0032	--	--	0.0027
	7/99	--	--	--	--	--	--
	1/00	--	0.0047	0.0044	--	--	--
	8/00	--	0.004B	0.0025B	--	--	--
	1/01	--	--	0.0041	--	--	0.0033
	8/01	--	--	--	--	--	--
	1/02	--	--	--	--	--	--
	8/02	--	--	--	--	--	--
	1/03	--	--	--	--	--	--
	7/03	--	--	0.0054	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	0.0031	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	--	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	--	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	0.0037	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	--	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	--	--	--	--
	6/20	--	0.0503	--	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--
	12/22	--	--	0.0041	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-05	10/92	--	0.45	0.235	--	--	--
	6/93	--	0.19	0.067	--	--	--
	11/93	NS	NS	NS	NS	NS	NS
	5/94	0.011	0.089	0.078	--	--	--
	1/95	--	0.653 *	0.050 *	--	--	--
	6/95	0.02	0.051	0.047	--	--	--
	9/95	--	0.014	0.0286	--	--	--
	11/95	--	0.073	0.0426	--	--	--
	3/96	0.0014 B	0.0315	0.023	--	--	--
	6/96	--	0.0127	0.0108	0.00065 B	--	--
	9/96	--	0.0167	0.018	--	--	--
	12/96	--	0.047	0.034	--	--	--
	2/97	--	--	--	--	--	--
	4/97	--	0.0684	0.0456	--	--	--
	7/97	--	--	--	--	--	--
	10/97	0.0012B	0.0025B	--	0.0011B	--	--
	1/98	--	--	--	--	--	--
	8/98	0.0253	0.0314	0.0199	--	--	--
	1/99	0.0456	0.0585	0.0536	0.0008	--	0.0022
	7/99	--	--	--	--	--	--
	1/00	--	0.0068	--	--	--	--
	8/00	--	0.0300	0.0158	--	--	--
	1/01	--	--	0.0033	--	--	--
	8/01	--	0.0110	0.0094	--	--	--
	1/02	--	0.0178	--	--	--	--
	8/02	--	0.0193	0.0126	--	--	--
	1/03	--	--	--	--	--	--
	7/03	--	0.0150	0.0112	--	--	--
	1/04	--	--	0.0033	--	--	--
	8/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	0.0031	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	0.0204	0.0100	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	0.0167	0.0068	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0032	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	0.185	0.158	--	--	0.0039
	6/19	--	--	--	--	--	--
	11/19	--	--	0.0039	--	--	--
	6/20	--	0.0223	0.0184	--	--	--
	12/20	--	0.129	0.105	--	--	--
	4/21	--	0.0148	0.0148	--	--	--
	11/21	--	0.0197	0.0187	--	--	--
	6/22	--	0.0171	0.0134	--	--	--
	12/22	--	--	0.0099	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-06A	1/95	0.005	0.103 *	0.240 *	--	--	--
	6/95	0.081	0.084	0.21	--	--	--
	9/95	0.0062	0.012	0.232	--	--	--
	11/95	--	0.117	0.271	--	--	--
	3/96	--	--	--	--	--	--
	6/96	--	0.145	0.388	--	--	--
	9/96	--	0.14	0.323	--	--	--
	12/96	--	0.134	0.345	--	--	--
	2/97	--	--	0.0029B	--	--	--
	4/97	--	0.0745	0.19	--	--	--
	7/97	--	0.0411	0.188	--	--	--
	10/97	0.0019B	0.005B	0.02	0.0051	--	--
	1/98	--	0.0021B	--	0.0011B	--	--
	8/98	0.046	0.0234	0.0544	0.0005	--	--
	1/99	0.0445	0.0241	0.0496	0.0008	0.002	--
	7/99	--	--	0.0095	--	--	--
	1/00	--	--	--	--	--	--
	8/00	--	0.0224	0.0494	--	--	--
	1/01	--	0.0161	0.0325	--	--	--
	8/01	--	0.0288	0.066	--	--	--
	1/02	--	0.014	0.0097	--	--	--
	8/02	--	0.0245	0.0451	--	--	--
	1/03	--	0.0392	0.0854	--	--	--
	7/03	--	--	0.0181	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	0.0059	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	--	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	0.0044	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	--	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	0.0059	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	--	--	--	--
	6/20	--	--	--	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--
	12/22	--	--	--	--	--	--
	5/23	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-06DA	1/95	--	0.021	UW	--	0.022	UW
	6/95	--	0.01	0.004	--	--	--
	9/95	--	0.014	0.0096	--	--	--
	11/95	--	--	0.0032	--	--	0.0034
	3/96	--	0.0166	0.0079	--	0.0155	0.0063
	6/96	0.00086 B	0.0412	0.0072	--	0.0414	0.0048
	9/96	--	0.041	0.0026 B	--	0.0397	0.0016 B
	12/96	--	0.022	0.004	0.001B	0.022 B	0.002 B
	2/97	0.0014B	0.0071B	0.0041	--	0.0072 B	0.0020 B
	4/97	--	0.022	0.0072	--	0.0183	--
	7/97	--	0.0569	0.0052	--	0.0577	--
	10/97	0.00066B	0.0143	0.0042	--	0.0144	0.0041
	1/98	--	0.0172	--	--	0.0135	--
	8/98	0.0006	0.0397	0.0035	--	0.0398	--
	1/99	0.0016	0.0278	0.0022	--	0.023	--
	7/99	0.0009	0.0383	0.0024	--	0.0452	--
	1/00	--	0.0153	--	--	0.0124	--
	8/00	--	0.0294	--	--	0.0286	--
	1/01	--	0.0161	--	--	0.0173	--
	8/01	--	--	--	--	0.0103	--
	1/02	--	0.0232	--	--	0.0214	--
	8/02	--	0.0342	--	--	0.0366	--
	1/03	--	0.0165	--	--	0.0167	--
	7/03	--	0.0252	--	--	0.0279	--
	1/04	--	0.0147	--	--	0.0142	--
	8/04	--	0.0281	--	--	0.0279	--
	1/05	--	0.0127	--	--	0.0119	--
	7/05	--	0.0197	--	--	0.0160	--
	1/06	--	--	--	--	--	--
	8/06	--	0.0153	--	--	0.0143	--
	1/07	--	--	--	--	--	--
	7/07	--	0.0119	--	--	0.0122	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	--	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	0.0052	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	0.0057	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	0.0045	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	0.0037
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0030	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	--	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	0.0034	--	--	--
	6/20	--	--	0.0043	--	--	--
	12/20	--	--	0.0058	--	--	--
	4/21	--	--	0.0045	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	0.0155	--	--	--
	12/22	--	--	0.0049	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-07	10/92	--	0.0386	0.0358	--	--	--
	6/93	--	0.16	0.13	--	--	--
	11/93	NS	NS	NS	NS	NS	NS
	5/94	0.006	0.012	--	--	--	--
	1/95	--	0.113	0.124 E	--	--	2.7 B
	6/95	0.011	0.027	0.024	--	--	--
	9/95	--	0.022	0.054 N	--	--	--
	11/95	--	--	0.0196	--	--	--
	3/96	--	--	--	--	--	--
	6/96	--	0.0012 B	0.0012 B	--	--	--
	9/96	--	--	--	--	--	--
	12/96	--	0.004 B	0.003	--	--	--
	2/97	--	--	0.0016 B	--	--	--
	4/97	--	--	--	--	--	--
	7/97	--	0.014	0.0154	0.0023B	--	--
	10/97	--	0.0012B	--	0.00052B	--	--
	1/98	--	0.0038B	0.0032	0.0024B	--	--
	8/98	0.0239	0.0238	0.029	--	--	--
	1/99	0.0008	0.0029	--	--	--	--
	7/99	--	--	0.0061	--	--	--
	1/00	--	--	--	--	--	--
	8/00	--	0.0037B	0.0037	--	--	--
	1/01	--	--	0.0035	--	--	--
	8/01	--	0.024	0.0227	--	--	--
	1/02	--	--	--	--	--	--
	8/02	--	--	0.0051	--	--	--
	1/03	--	--	--	--	--	--
	7/03	--	0.0699	0.0838	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	0.0037	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	0.0104	0.010	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	0.003	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	--	--	--	--
	7/16	--	--	0.0073	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	0.0047	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	0.0116	0.0141	--	--	--
	6/20	--	--	--	--	--	--
	12/20	--	0.0489	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--
	12/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-09	10/92	0.0915	0.001	--	--	--	--
	6/93	--	0.001	--	--	--	--
	11/93	0.069	NA	NA	--	NA	NA
	5/94	--	--	--	--	--	--
	1/95	0.469 *	0.152	0.163 E	--	--	NA
	6/95	0.078	0.048	0.16	--	--	--
	9/95	0.0458	0.011	0.0651	--	--	--
	11/95	0.0218	0.0632	0.0991	--	--	--
	3/96	--	0.0096 B	--	--	0.0015 B	--
	6/96	--	--	--	0.00045 B	--	--
	9/96	--	--	--	0.00021 B	--	--
	12/96	0.011	0.025	0.040	--	--	--
	2/97	0.0074B	--	--	0.00064B	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	0.0019B	--	--	0.0025B	--	--
	1/98	--	0.0015B	--	0.0012B	--	--
	8/98	0.0112	0.0061	0.0094	0.0012	--	--
	1/99	0.0011	0.0012	--	0.0013	--	0.0038
	7/99	0.0023	--	0.0032	0.0018	--	--
	1/00	0.0038	0.002	0.0042	0.0017	--	--
	8/00	0.0069	0.0075B	0.0079	0.0012B	--	--
	1/01	0.0089	--	0.0125	--	--	--
	8/01	0.006	--	0.0113	--	--	--
	1/02	0.0064	--	--	0.0062	--	--
	8/02	--	--	--	--	--	--
	1/03	0.0085	--	--	0.0057	--	--
	7/03	--	--	0.0049	--	--	--
	1/04	0.0060	--	--	0.0065	--	--
	8/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	--	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0047	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	0.012	--	--	--	--	--
	8/18	0.0066	--	--	--	--	--
	6/19	--	--	--	--	--	--
	11/19	0.027	--	0.0129	--	--	--
	6/20	--	0.0495	--	--	--	--
	12/20	--	0.0189	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	0.0262	0.0367	0.0518	--	--	--
	6/22	--	--	0.0142	--	--	--
	12/22	--	--	0.0037	--	--	--
	5/23	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-09D	10/92	--	0.644	0.381	--	--	--
	6/93	--	0.045	0.023	--	--	--
	11/93	--	NA	NA	--	NA	NA
	5/94	--	0.016	--	--	--	--
	1/95	--	0.085	0.052 E	--	--	--
	6/95	0.009	0.02	0.0255 N	--	--	--
	9/95	--	--	0.019	--	--	--
	11/95	--	0.0243	0.019	--	--	--
	3/96	--	0.005 B	--	0.00068	--	--
	6/96	--	0.0031 B	0.0034	0.00046 B	--	--
	9/96	0.00033 B	0.0030 B	0.0010 B	0.00022 B	--	--
	12/96	--	--	--	--	--	--
	2/97	--	--	--	--	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	--	--	--	--	--	--
	1/98	--	--	--	--	--	--
	8/98	0.0012	0.0015	--	--	--	--
	1/99	0.0008	0.0037	--	0.0005	--	--
	7/99	--	--	--	--	--	--
	1/00	--	--	--	--	--	--
	8/00	--	--	--	--	--	--
	1/01	--	--	--	--	--	--
	8/01	--	--	--	--	--	--
	1/02	--	0.0126	--	--	--	--
	8/02	--	--	--	--	--	--
	1/03	--	--	--	--	--	--
	7/03	--	--	--	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	--	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0031	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	0.0040	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	0.0036	--	--	--
	6/20	--	--	0.006	--	--	--
	12/20	--	0.0286	--	--	--	--
	4/21	--	0.0123	0.0095	--	--	--
	11/21	--	--	0.0037	--	--	--
	6/22	--	--	0.0114	--	--	--
	12/22	--	--	0.0078	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-11	10/92	--	0.595	0.384	--	--	--
	6/93	--	0.1	0.076	--	--	--
	11/93	0.011	NA	NA	--	NA	NA
	5/94	0.017	--	--	--	--	--
	1/95	--	0.253	0.228 E	--	--	--
	6/95	0.087	0.18	0.17	--	--	--
	9/95	--	--	0.005 WN	--	--	--
	11/95	--	0.152	0.161	--	--	0.0077
	3/96	--	--	--	--	--	--
	6/96	--	--	--	--	--	--
	9/96	--	--	0.0013 B	0.00095B	--	--
	12/96	--	0.044	0.054	--	--	--
	2/97	--	0.0124	0.0144	--	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	--	--	--	--	--	--
	1/98	--	0.0138	0.0162	0.0024B	--	--
	8/98	0.0053	0.0065	0.0056	--	--	--
	1/99	0.0050	0.0042	0.0035	0.0029	--	--
	7/99	--	--	--	--	--	--
	1/00	--	0.005	0.0041	--	--	--
	8/00	--	0.0031	--	--	--	--
	1/01	--	--	0.0083	--	--	--
	8/01	--	0.026	0.0264	--	--	--
	1/02	--	--	--	--	--	--
	8/02	--	--	--	--	--	--
	1/03	--	--	0.0053	--	--	--
	7/03	--	--	0.0070	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	0.0031	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	--	--	0.0085	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	0.0047	--	--	0.007
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0036	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	--	--	--	--
	6/19	--	--	0.0059	--	--	--
	11/19	--	--	--	--	--	--
	6/20	--	0.162	--	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--
	12/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-12	9/96	--	0.0022B	0.0016B	--	--	--
	12/96	--	0.048	0.053	0.001B	0.003B	--
	2/97	NS	NS	NS	NS	NS	NS
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	--	--	--	--	--	--
	1/98	--	0.0021B	--	--	--	--
	8/98	0.0016	0.0022	--	--	--	--
	1/99	NS	NS	NS	NS	NS	NS
	7/99	--	--	--	--	--	--
	1/00	0.0013	--	--	--	--	--
	8/00	--	--	--	--	--	--
	8/01	--	--	0.0048	--	--	--
	1/02	--	--	--	--	--	--
	8/02	--	--	--	--	--	--
	1/03	NS	NS	NS	NS	NS	NS
	7/03	--	--	0.0060	--	--	--
	1/04	--	--	--	--	--	--
	8/04	0.008	--	0.0058	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	NS	NS	NS	NS	NS	NS
	7/09	--	--	--	--	--	--
	4/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	0.0121	0.0197	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	--	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	NS	NS	NS	NS	NS	NS
	8/18	--	--	0.007	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	--	--	--	--
	6/20	--	--	--	--	--	--
	12/20	--	--	0.0039	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	0.0115	0.0121	--	--	--
	6/22	--	--	--	--	--	--
	12/22	--	--	--	--	--	--
	5/23	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-13	9/96	--	0.0024B	0.0012B	--	--	--
	12/96	--	0.07	0.05	--	--	--
	2/97	--	0.0023B	0.0020B	--	--	--
	4/97	--	--	--	--	--	--
	7/97	--	--	--	--	--	--
	10/97	--	0.0012B	--	--	--	--
	1/98	--	--	--	0.0042B	--	--
	8/98	0.0086	0.0087	0.0076	--	--	--
	1/99	0.0033	0.002	--	0.0006	0.0017	0.0035
	7/99	--	--	0.002	--	--	--
	1/00	--	--	--	--	--	--
	8/00	--	0.017	0.0093	--	--	--
	1/01	--	--	--	--	--	--
	8/01	--	0.012	0.0094	--	--	--
	1/02	--	0.0107	0.0041	--	--	--
	8/02	--	--	--	--	--	--
	1/03	--	0.0103	0.0036	--	--	--
	7/03	--	0.024	0.0176	--	--	--
	1/04	--	--	--	--	--	0.0035
	8/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	0.0345	--	0.00368	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	0.0030	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	0.0064	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	--	--	--	--
	6/20	--	0.342	0.0034	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	--	--	--	--	--
	12/22	--	--	--	--	--	--

Table 2. Summary of Total and Dissolved Cadmium, Chromium and Lead - Arcade, New York

Well Number	Date Sampled	Parameters					
		Total (mg/L)			Dissolved (mg/L)		
		Cadmium	Chromium	Lead	Cadmium	Chromium	Lead
MW-14	8/00	0.005	0.010	0.003	--	--	--
	1/01	--	--	--	--	--	--
	8/01	--	--	--	--	--	--
	1/02	--	--	--	--	--	--
	8/02	--	--	--	--	--	--
	1/03	--	--	--	--	--	--
	7/03	--	--	--	--	--	--
	1/04	--	--	--	--	--	--
	8/04	--	--	--	--	--	--
	1/05	--	--	--	--	--	--
	7/05	--	--	--	--	--	--
	1/06	--	--	--	--	--	--
	8/06	--	--	--	--	--	--
	1/07	--	--	--	--	--	--
	7/07	--	--	--	--	--	--
	1/08	--	--	--	--	--	--
	7/08	--	--	--	--	--	--
	1/09	0.0824	--	0.00481	--	--	--
	7/09	--	--	--	--	--	--
	2/10	--	--	--	--	--	--
	8/10	--	--	--	--	--	--
	1/11	--	--	--	--	--	--
	8/11	--	--	--	--	--	--
	1/12	--	--	--	--	--	--
	8/12	--	--	--	--	--	--
	1/13	--	--	--	--	--	--
	8/13	--	--	--	--	--	--
	1/14	--	--	--	--	--	--
	8/14	--	--	--	--	--	--
	1/15	--	--	--	--	--	--
	7/15	--	--	--	--	--	--
	1/16	--	--	--	--	--	--
	7/16	--	--	--	--	--	--
	1/17	--	--	--	--	--	--
	7/17	--	--	--	--	--	--
	1/18	--	--	--	--	--	--
	8/18	--	--	--	--	--	--
	6/19	--	--	--	--	--	--
	11/19	--	--	--	--	--	--
	6/20	--	0.0268	--	--	--	--
	12/20	--	--	--	--	--	--
	4/21	--	--	--	--	--	--
	11/21	--	--	--	--	--	--
	6/22	--	0.0274	0.0231	--	--	--
	12/22	--	--	0.0065	--	--	--

NOTES:

NA - Not Analyzed

NS - Not Sampled

Abd - Abandoned

* - Indicates duplicate analysis not within control limits.

S - Indicates value determined by Method of Standard Addition.

-- - The analyte was analyzed for but not detected.

B - The reported value was obtained from a reading that was less than the Contract Required Detection Limit (CRDL) but greater than or equal to the Instrument Detection Limit (IDL).

E - Indicates a value estimated or not reported due to the presence of interference.

W - Post digestion spike for Furnace AA analysis out of control limits (85-115%), while sample absorbance is less than 50% of spike absorbance.

N - Indicates spike sample recovery is not within control limits.

ATTACHMENT 3

Analytical Data Package and Field Sampling Report

ANALYTICAL REPORT

PREPARED FOR

Attn: Mr. Rich Gnat
KPRG and Associates, Inc.
14665 West Lisbon Road,
Suite 1A
Brookfield, Wisconsin 53005

Generated 12/19/2022 3:43:15 PM

JOB DESCRIPTION

Prestolite site
Prestolite site

JOB NUMBER

480-204477-1


Eurofins Buffalo

Job Notes

The test results in this report meet all NELAP requirements for parameters for which accreditation is required or available. Any exceptions to the NELAP requirements are noted in this report. Pursuant to NELAP, this report may not be reproduced, except in full, without the written approval of the laboratory. This report is confidential and is intended for the sole use of Eurofins Environment Testing Northeast, LLC Buffalo and its client. All questions regarding this report should be directed to the Eurofins Environment Testing Northeast, LLC Buffalo Project Manager or designee who has signed this report.

The test results in this report relate only to the samples as received by the laboratory and will meet all requirements of the methodology, with any exceptions noted. This report shall not be reproduced except in full, without the express written approval of the laboratory. All questions should be directed to the Eurofins Environment Testing Northeast, LLC Project Manager.

Authorization



Generated
12/19/2022 3:43:15 PM

Authorized for release by
Brian Fischer, Manager of Project Management
Brian.Fischer@et.eurofinsus.com
(716)504-9835

Table of Contents

Cover Page	1
Table of Contents	3
Definitions/Glossary	4
Case Narrative	5
Detection Summary	6
Client Sample Results	8
Surrogate Summary	24
QC Sample Results	25
QC Association Summary	30
Lab Chronicle	33
Certification Summary	37
Method Summary	38
Sample Summary	39
Detection Limit Exceptions Summary	40
Chain of Custody	41
Receipt Checklists	43



Definitions/Glossary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Qualifiers

GC/MS VOA

Qualifier	Qualifier Description
*+	LCS and/or LCSD is outside acceptance limits, high biased.
F1	MS and/or MSD recovery exceeds control limits.
J	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.
U	Indicates the analyte was analyzed for but not detected.

Metals

Qualifier	Qualifier Description
U	Indicates the analyte was analyzed for but not detected.

Glossary

Abbreviation	These commonly used abbreviations may or may not be present in this report.
□	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CFL	Contains Free Liquid
CFU	Colony Forming Unit
CNF	Contains No Free Liquid
DER	Duplicate Error Ratio (normalized absolute difference)
Dil Fac	Dilution Factor
DL	Detection Limit (DoD/DOE)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision Level Concentration (Radiochemistry)
EDL	Estimated Detection Limit (Dioxin)
LOD	Limit of Detection (DoD/DOE)
LOQ	Limit of Quantitation (DoD/DOE)
MCL	EPA recommended "Maximum Contaminant Level"
MDA	Minimum Detectable Activity (Radiochemistry)
MDC	Minimum Detectable Concentration (Radiochemistry)
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
MPN	Most Probable Number
MQL	Method Quantitation Limit
NC	Not Calculated
ND	Not Detected at the reporting limit (or MDL or EDL if shown)
NEG	Negative / Absent
POS	Positive / Present
PQL	Practical Quantitation Limit
PRES	Presumptive
QC	Quality Control
RER	Relative Error Ratio (Radiochemistry)
RL	Reporting Limit or Requested Limit (Radiochemistry)
RPD	Relative Percent Difference, a measure of the relative difference between two points
TEF	Toxicity Equivalent Factor (Dioxin)
TEQ	Toxicity Equivalent Quotient (Dioxin)
TNTC	Too Numerous To Count

Case Narrative

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Job ID: 480-204477-1

Laboratory: Eurofins Buffalo

Narrative

Job Narrative 480-204477-1

Comments

No additional comments.

Receipt

The samples were received on 12/6/2022 2:00 PM. Unless otherwise noted below, the samples arrived in good condition, and where required, properly preserved and on ice. The temperature of the cooler at receipt was 3.0° C.

GC/MS VOA

Method 8260C: The continuing calibration verification (CCV) associated with batch 480-652688 recovered above the upper control limit for 4-Methyl-2-pentanone (MIBK) and 2-Hexanone. The samples associated with this CCV were non-detects for the affected analytes; therefore, the data have been reported. The associated samples are impacted: MW-11 (480-204477-2), MW-11 (480-204477-2[MS]), MW-14 (480-204477-5), MW-2A (480-204477-7), MW-3 (480-204477-8), MW-5 (480-204477-9), MW-6A (480-204477-10), MW-6DA (480-204477-11), MW-7 (480-204477-12), TRIP BLANK (480-204477-15) and Dup (480-204477-16).

Method 8260C: The laboratory control sample (LCS) for analytical batch 480-652688 recovered outside control limits for the following analytes: 4-Methyl-2-pentanone (MIBK) and 2-Hexanone. These analytes were biased high in the LCS and were not detected in the associated samples; therefore, the data have been reported. The associated samples are impacted: MW-11 (480-204477-2), MW-11 (480-204477-2[MS]), MW-11 (480-204477-2[MSD]), MW-14 (480-204477-5), MW-2A (480-204477-7), MW-3 (480-204477-8), MW-5 (480-204477-9), MW-6A (480-204477-10), MW-6DA (480-204477-11), MW-7 (480-204477-12), TRIP BLANK (480-204477-15) and Dup (480-204477-16).

No additional analytical or quality issues were noted, other than those described above or in the Definitions/Glossary page.

Metals

No analytical or quality issues were noted, other than those described in the Definitions/Glossary page.

Detection Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-1

Lab Sample ID: 480-204477-1

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	13		10	0.46	ug/L	1		8260C	Total/NA
Lead	3.1		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: MW-11

Lab Sample ID: 480-204477-2

No Detections.

Client Sample ID: MW-12

Lab Sample ID: 480-204477-3

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
1,1,1-Trichloroethane	1.1	J	10	0.82	ug/L	1		8260C	Total/NA
Trichloroethene	14		10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-13

Lab Sample ID: 480-204477-4

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	1.2	J	10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-14

Lab Sample ID: 480-204477-5

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Lead	6.5		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: MW-1DA

Lab Sample ID: 480-204477-6

No Detections.

Client Sample ID: MW-2A

Lab Sample ID: 480-204477-7

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	0.93	J	10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-3

Lab Sample ID: 480-204477-8

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	0.65	J	10	0.46	ug/L	1		8260C	Total/NA
Lead	4.1		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: MW-5

Lab Sample ID: 480-204477-9

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Lead	9.9		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: MW-6A

Lab Sample ID: 480-204477-10

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	16		10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-6DA

Lab Sample ID: 480-204477-11

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Lead	4.9		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: MW-7

Lab Sample ID: 480-204477-12

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Chloromethane	0.35	J	10	0.35	ug/L	1		8260C	Total/NA

This Detection Summary does not include radiochemical test results.

Eurofins Buffalo

Detection Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-9

Lab Sample ID: 480-204477-13

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
1,1-Dichloroethane	0.56	J	10	0.38	ug/L	1		8260C	Total/NA
Trichloroethene	5.9	J	10	0.46	ug/L	1		8260C	Total/NA
1,2-Dichloroethene, Total	2.6	J	10	0.81	ug/L	1		8260C	Total/NA
Lead	3.7		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: MW-9D

Lab Sample ID: 480-204477-14

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Lead	7.8		3.0		ug/L	1		6010C	Total/NA

Client Sample ID: TRIP BLANK

Lab Sample ID: 480-204477-15

No Detections.

Client Sample ID: Dup

Lab Sample ID: 480-204477-16

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	0.60	J	10	0.46	ug/L	1		8260C	Total/NA

This Detection Summary does not include radiochemical test results.

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-1

Lab Sample ID: 480-204477-1

Date Collected: 12/02/22 10:45

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/08/22 06:12	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/08/22 06:12	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/08/22 06:12	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/08/22 06:12	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/08/22 06:12	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/08/22 06:12	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/08/22 06:12	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/08/22 06:12	1
2-Hexanone	10	U	10	1.2	ug/L			12/08/22 06:12	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			12/08/22 06:12	1
Acetone	10	U	10	3.0	ug/L			12/08/22 06:12	1
Benzene	10	U	10	0.41	ug/L			12/08/22 06:12	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/08/22 06:12	1
Bromoform	10	U	10	0.26	ug/L			12/08/22 06:12	1
Bromomethane	10	U	10	0.69	ug/L			12/08/22 06:12	1
Carbon disulfide	10	U	10	0.19	ug/L			12/08/22 06:12	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/08/22 06:12	1
Chlorobenzene	10	U	10	0.75	ug/L			12/08/22 06:12	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/08/22 06:12	1
Chloroethane	10	U	10	0.32	ug/L			12/08/22 06:12	1
Chloroform	10	U	10	0.34	ug/L			12/08/22 06:12	1
Chloromethane	10	U	10	0.35	ug/L			12/08/22 06:12	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/08/22 06:12	1
Ethylbenzene	10	U	10	0.74	ug/L			12/08/22 06:12	1
Methylene Chloride	10	U	10	0.44	ug/L			12/08/22 06:12	1
Styrene	10	U	10	0.73	ug/L			12/08/22 06:12	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/08/22 06:12	1
Toluene	10	U	10	0.51	ug/L			12/08/22 06:12	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/08/22 06:12	1
Trichloroethene	13		10	0.46	ug/L			12/08/22 06:12	1
Vinyl chloride	10	U	10	0.90	ug/L			12/08/22 06:12	1
Xylenes, Total	10	U	10	0.66	ug/L			12/08/22 06:12	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/08/22 06:12	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	104		77 - 120		12/08/22 06:12	1
Toluene-d8 (Surr)	100		80 - 120		12/08/22 06:12	1
4-Bromofluorobenzene (Surr)	102		73 - 120		12/08/22 06:12	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/09/22 21:54	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/09/22 21:54	1
Lead	3.1		3.0		ug/L		12/08/22 09:11	12/09/22 21:54	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 00:45	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 00:45	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 00:45	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-11

Lab Sample ID: 480-204477-2

Date Collected: 12/05/22 10:59

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/09/22 01:47	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/09/22 01:47	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/09/22 01:47	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/09/22 01:47	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/09/22 01:47	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/09/22 01:47	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/09/22 01:47	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/09/22 01:47	1
2-Hexanone	10	*+ F1 U	10	1.2	ug/L			12/09/22 01:47	1
4-Methyl-2-pentanone (MIBK)	10	*+ F1 U	10	2.1	ug/L			12/09/22 01:47	1
Acetone	10	U	10	3.0	ug/L			12/09/22 01:47	1
Benzene	10	U	10	0.41	ug/L			12/09/22 01:47	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/09/22 01:47	1
Bromoform	10	U	10	0.26	ug/L			12/09/22 01:47	1
Bromomethane	10	U	10	0.69	ug/L			12/09/22 01:47	1
Carbon disulfide	10	U	10	0.19	ug/L			12/09/22 01:47	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/09/22 01:47	1
Chlorobenzene	10	U	10	0.75	ug/L			12/09/22 01:47	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/09/22 01:47	1
Chloroethane	10	U	10	0.32	ug/L			12/09/22 01:47	1
Chloroform	10	U	10	0.34	ug/L			12/09/22 01:47	1
Chloromethane	10	F1 U	10	0.35	ug/L			12/09/22 01:47	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/09/22 01:47	1
Ethylbenzene	10	U	10	0.74	ug/L			12/09/22 01:47	1
Methylene Chloride	10	U	10	0.44	ug/L			12/09/22 01:47	1
Styrene	10	U	10	0.73	ug/L			12/09/22 01:47	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/09/22 01:47	1
Toluene	10	U	10	0.51	ug/L			12/09/22 01:47	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/09/22 01:47	1
Trichloroethene	10	U	10	0.46	ug/L			12/09/22 01:47	1
Vinyl chloride	10	U	10	0.90	ug/L			12/09/22 01:47	1
Xylenes, Total	10	U	10	0.66	ug/L			12/09/22 01:47	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/09/22 01:47	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	107		77 - 120		12/09/22 01:47	1
Toluene-d8 (Surr)	92		80 - 120		12/09/22 01:47	1
4-Bromofluorobenzene (Surr)	87		73 - 120		12/09/22 01:47	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/09/22 21:58	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/09/22 21:58	1
Lead	3.0	U	3.0		ug/L		12/08/22 09:11	12/09/22 21:58	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 01:00	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 01:00	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 01:00	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-12

Lab Sample ID: 480-204477-3

Date Collected: 12/02/22 10:01

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	1.1	J	10	0.82	ug/L			12/08/22 06:35	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/08/22 06:35	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/08/22 06:35	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/08/22 06:35	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/08/22 06:35	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/08/22 06:35	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/08/22 06:35	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/08/22 06:35	1
2-Hexanone	10	U	10	1.2	ug/L			12/08/22 06:35	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			12/08/22 06:35	1
Acetone	10	U	10	3.0	ug/L			12/08/22 06:35	1
Benzene	10	U	10	0.41	ug/L			12/08/22 06:35	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/08/22 06:35	1
Bromoform	10	U	10	0.26	ug/L			12/08/22 06:35	1
Bromomethane	10	U	10	0.69	ug/L			12/08/22 06:35	1
Carbon disulfide	10	U	10	0.19	ug/L			12/08/22 06:35	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/08/22 06:35	1
Chlorobenzene	10	U	10	0.75	ug/L			12/08/22 06:35	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/08/22 06:35	1
Chloroethane	10	U	10	0.32	ug/L			12/08/22 06:35	1
Chloroform	10	U	10	0.34	ug/L			12/08/22 06:35	1
Chloromethane	10	U	10	0.35	ug/L			12/08/22 06:35	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/08/22 06:35	1
Ethylbenzene	10	U	10	0.74	ug/L			12/08/22 06:35	1
Methylene Chloride	10	U	10	0.44	ug/L			12/08/22 06:35	1
Styrene	10	U	10	0.73	ug/L			12/08/22 06:35	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/08/22 06:35	1
Toluene	10	U	10	0.51	ug/L			12/08/22 06:35	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/08/22 06:35	1
Trichloroethene	14		10	0.46	ug/L			12/08/22 06:35	1
Vinyl chloride	10	U	10	0.90	ug/L			12/08/22 06:35	1
Xylenes, Total	10	U	10	0.66	ug/L			12/08/22 06:35	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/08/22 06:35	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	106		77 - 120		12/08/22 06:35	1
Toluene-d8 (Surr)	99		80 - 120		12/08/22 06:35	1
4-Bromofluorobenzene (Surr)	102		73 - 120		12/08/22 06:35	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/15/22 16:18	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/15/22 16:18	1
Lead	3.0	U	3.0		ug/L		12/08/22 09:11	12/15/22 16:18	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 01:19	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 01:19	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 01:19	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-13

Lab Sample ID: 480-204477-4

Date Collected: 12/02/22 08:41

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/08/22 06:58	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/08/22 06:58	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/08/22 06:58	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/08/22 06:58	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/08/22 06:58	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/08/22 06:58	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/08/22 06:58	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/08/22 06:58	1
2-Hexanone	10	U	10	1.2	ug/L			12/08/22 06:58	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			12/08/22 06:58	1
Acetone	10	U	10	3.0	ug/L			12/08/22 06:58	1
Benzene	10	U	10	0.41	ug/L			12/08/22 06:58	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/08/22 06:58	1
Bromoform	10	U	10	0.26	ug/L			12/08/22 06:58	1
Bromomethane	10	U	10	0.69	ug/L			12/08/22 06:58	1
Carbon disulfide	10	U	10	0.19	ug/L			12/08/22 06:58	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/08/22 06:58	1
Chlorobenzene	10	U	10	0.75	ug/L			12/08/22 06:58	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/08/22 06:58	1
Chloroethane	10	U	10	0.32	ug/L			12/08/22 06:58	1
Chloroform	10	U	10	0.34	ug/L			12/08/22 06:58	1
Chloromethane	10	U	10	0.35	ug/L			12/08/22 06:58	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/08/22 06:58	1
Ethylbenzene	10	U	10	0.74	ug/L			12/08/22 06:58	1
Methylene Chloride	10	U	10	0.44	ug/L			12/08/22 06:58	1
Styrene	10	U	10	0.73	ug/L			12/08/22 06:58	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/08/22 06:58	1
Toluene	10	U	10	0.51	ug/L			12/08/22 06:58	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/08/22 06:58	1
Trichloroethene	1.2	J	10	0.46	ug/L			12/08/22 06:58	1
Vinyl chloride	10	U	10	0.90	ug/L			12/08/22 06:58	1
Xylenes, Total	10	U	10	0.66	ug/L			12/08/22 06:58	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/08/22 06:58	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	111		77 - 120		12/08/22 06:58	1
Toluene-d8 (Surr)	100		80 - 120		12/08/22 06:58	1
4-Bromofluorobenzene (Surr)	98		73 - 120		12/08/22 06:58	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/15/22 16:22	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/15/22 16:22	1
Lead	3.0	U	3.0		ug/L		12/08/22 09:11	12/15/22 16:22	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 01:23	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 01:23	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 01:23	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-14

Lab Sample ID: 480-204477-5

Date Collected: 12/05/22 10:03

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/09/22 02:09	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/09/22 02:09	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/09/22 02:09	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/09/22 02:09	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/09/22 02:09	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/09/22 02:09	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/09/22 02:09	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/09/22 02:09	1
2-Hexanone	10	*+ U	10	1.2	ug/L			12/09/22 02:09	1
4-Methyl-2-pentanone (MIBK)	10	*+ U	10	2.1	ug/L			12/09/22 02:09	1
Acetone	10	U	10	3.0	ug/L			12/09/22 02:09	1
Benzene	10	U	10	0.41	ug/L			12/09/22 02:09	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/09/22 02:09	1
Bromoform	10	U	10	0.26	ug/L			12/09/22 02:09	1
Bromomethane	10	U	10	0.69	ug/L			12/09/22 02:09	1
Carbon disulfide	10	U	10	0.19	ug/L			12/09/22 02:09	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/09/22 02:09	1
Chlorobenzene	10	U	10	0.75	ug/L			12/09/22 02:09	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/09/22 02:09	1
Chloroethane	10	U	10	0.32	ug/L			12/09/22 02:09	1
Chloroform	10	U	10	0.34	ug/L			12/09/22 02:09	1
Chloromethane	10	U	10	0.35	ug/L			12/09/22 02:09	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/09/22 02:09	1
Ethylbenzene	10	U	10	0.74	ug/L			12/09/22 02:09	1
Methylene Chloride	10	U	10	0.44	ug/L			12/09/22 02:09	1
Styrene	10	U	10	0.73	ug/L			12/09/22 02:09	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/09/22 02:09	1
Toluene	10	U	10	0.51	ug/L			12/09/22 02:09	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/09/22 02:09	1
Trichloroethene	10	U	10	0.46	ug/L			12/09/22 02:09	1
Vinyl chloride	10	U	10	0.90	ug/L			12/09/22 02:09	1
Xylenes, Total	10	U	10	0.66	ug/L			12/09/22 02:09	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/09/22 02:09	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	107		77 - 120		12/09/22 02:09	1
Toluene-d8 (Surr)	92		80 - 120		12/09/22 02:09	1
4-Bromofluorobenzene (Surr)	87		73 - 120		12/09/22 02:09	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/15/22 16:26	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/15/22 16:26	1
Lead	6.5		3.0		ug/L		12/08/22 09:11	12/15/22 16:26	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 01:27	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 01:27	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 01:27	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-1DA

Lab Sample ID: 480-204477-6

Date Collected: 12/02/22 11:59

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/08/22 07:21	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/08/22 07:21	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/08/22 07:21	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/08/22 07:21	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/08/22 07:21	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/08/22 07:21	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/08/22 07:21	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/08/22 07:21	1
2-Hexanone	10	U	10	1.2	ug/L			12/08/22 07:21	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			12/08/22 07:21	1
Acetone	10	U	10	3.0	ug/L			12/08/22 07:21	1
Benzene	10	U	10	0.41	ug/L			12/08/22 07:21	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/08/22 07:21	1
Bromoform	10	U	10	0.26	ug/L			12/08/22 07:21	1
Bromomethane	10	U	10	0.69	ug/L			12/08/22 07:21	1
Carbon disulfide	10	U	10	0.19	ug/L			12/08/22 07:21	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/08/22 07:21	1
Chlorobenzene	10	U	10	0.75	ug/L			12/08/22 07:21	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/08/22 07:21	1
Chloroethane	10	U	10	0.32	ug/L			12/08/22 07:21	1
Chloroform	10	U	10	0.34	ug/L			12/08/22 07:21	1
Chloromethane	10	U	10	0.35	ug/L			12/08/22 07:21	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/08/22 07:21	1
Ethylbenzene	10	U	10	0.74	ug/L			12/08/22 07:21	1
Methylene Chloride	10	U	10	0.44	ug/L			12/08/22 07:21	1
Styrene	10	U	10	0.73	ug/L			12/08/22 07:21	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/08/22 07:21	1
Toluene	10	U	10	0.51	ug/L			12/08/22 07:21	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/08/22 07:21	1
Trichloroethene	10	U	10	0.46	ug/L			12/08/22 07:21	1
Vinyl chloride	10	U	10	0.90	ug/L			12/08/22 07:21	1
Xylenes, Total	10	U	10	0.66	ug/L			12/08/22 07:21	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/08/22 07:21	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	107		77 - 120		12/08/22 07:21	1
Toluene-d8 (Surr)	97		80 - 120		12/08/22 07:21	1
4-Bromofluorobenzene (Surr)	97		73 - 120		12/08/22 07:21	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/15/22 16:30	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/15/22 16:30	1
Lead	3.0	U	3.0		ug/L		12/08/22 09:11	12/15/22 16:30	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 01:31	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 01:31	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 01:31	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-2A

Lab Sample ID: 480-204477-7

Date Collected: 12/05/22 14:12

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/09/22 02:31	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/09/22 02:31	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/09/22 02:31	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/09/22 02:31	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/09/22 02:31	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/09/22 02:31	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/09/22 02:31	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/09/22 02:31	1
2-Hexanone	10	*+ U	10	1.2	ug/L			12/09/22 02:31	1
4-Methyl-2-pentanone (MIBK)	10	*+ U	10	2.1	ug/L			12/09/22 02:31	1
Acetone	10	U	10	3.0	ug/L			12/09/22 02:31	1
Benzene	10	U	10	0.41	ug/L			12/09/22 02:31	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/09/22 02:31	1
Bromoform	10	U	10	0.26	ug/L			12/09/22 02:31	1
Bromomethane	10	U	10	0.69	ug/L			12/09/22 02:31	1
Carbon disulfide	10	U	10	0.19	ug/L			12/09/22 02:31	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/09/22 02:31	1
Chlorobenzene	10	U	10	0.75	ug/L			12/09/22 02:31	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/09/22 02:31	1
Chloroethane	10	U	10	0.32	ug/L			12/09/22 02:31	1
Chloroform	10	U	10	0.34	ug/L			12/09/22 02:31	1
Chloromethane	10	U	10	0.35	ug/L			12/09/22 02:31	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/09/22 02:31	1
Ethylbenzene	10	U	10	0.74	ug/L			12/09/22 02:31	1
Methylene Chloride	10	U	10	0.44	ug/L			12/09/22 02:31	1
Styrene	10	U	10	0.73	ug/L			12/09/22 02:31	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/09/22 02:31	1
Toluene	10	U	10	0.51	ug/L			12/09/22 02:31	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/09/22 02:31	1
Trichloroethene	0.93	J	10	0.46	ug/L			12/09/22 02:31	1
Vinyl chloride	10	U	10	0.90	ug/L			12/09/22 02:31	1
Xylenes, Total	10	U	10	0.66	ug/L			12/09/22 02:31	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/09/22 02:31	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	107		77 - 120		12/09/22 02:31	1
Toluene-d8 (Surr)	92		80 - 120		12/09/22 02:31	1
4-Bromofluorobenzene (Surr)	88		73 - 120		12/09/22 02:31	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/15/22 16:34	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/15/22 16:34	1
Lead	3.0	U	3.0		ug/L		12/08/22 09:11	12/15/22 16:34	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 01:46	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 01:46	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 01:46	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-3

Lab Sample ID: 480-204477-8

Date Collected: 12/05/22 12:16

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/09/22 02:53	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/09/22 02:53	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/09/22 02:53	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/09/22 02:53	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/09/22 02:53	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/09/22 02:53	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/09/22 02:53	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/09/22 02:53	1
2-Hexanone	10	*+ U	10	1.2	ug/L			12/09/22 02:53	1
4-Methyl-2-pentanone (MIBK)	10	*+ U	10	2.1	ug/L			12/09/22 02:53	1
Acetone	10	U	10	3.0	ug/L			12/09/22 02:53	1
Benzene	10	U	10	0.41	ug/L			12/09/22 02:53	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/09/22 02:53	1
Bromoform	10	U	10	0.26	ug/L			12/09/22 02:53	1
Bromomethane	10	U	10	0.69	ug/L			12/09/22 02:53	1
Carbon disulfide	10	U	10	0.19	ug/L			12/09/22 02:53	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/09/22 02:53	1
Chlorobenzene	10	U	10	0.75	ug/L			12/09/22 02:53	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/09/22 02:53	1
Chloroethane	10	U	10	0.32	ug/L			12/09/22 02:53	1
Chloroform	10	U	10	0.34	ug/L			12/09/22 02:53	1
Chloromethane	10	U	10	0.35	ug/L			12/09/22 02:53	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/09/22 02:53	1
Ethylbenzene	10	U	10	0.74	ug/L			12/09/22 02:53	1
Methylene Chloride	10	U	10	0.44	ug/L			12/09/22 02:53	1
Styrene	10	U	10	0.73	ug/L			12/09/22 02:53	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/09/22 02:53	1
Toluene	10	U	10	0.51	ug/L			12/09/22 02:53	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/09/22 02:53	1
Trichloroethene	0.65	J	10	0.46	ug/L			12/09/22 02:53	1
Vinyl chloride	10	U	10	0.90	ug/L			12/09/22 02:53	1
Xylenes, Total	10	U	10	0.66	ug/L			12/09/22 02:53	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/09/22 02:53	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	107		77 - 120		12/09/22 02:53	1
Toluene-d8 (Surr)	93		80 - 120		12/09/22 02:53	1
4-Bromofluorobenzene (Surr)	88		73 - 120		12/09/22 02:53	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/15/22 16:38	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/15/22 16:38	1
Lead	4.1		3.0		ug/L		12/08/22 09:11	12/15/22 16:38	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 01:50	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 01:50	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 01:50	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-5

Lab Sample ID: 480-204477-9

Date Collected: 12/05/22 14:55

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/09/22 03:15	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/09/22 03:15	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/09/22 03:15	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/09/22 03:15	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/09/22 03:15	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/09/22 03:15	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/09/22 03:15	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/09/22 03:15	1
2-Hexanone	10	*+ U	10	1.2	ug/L			12/09/22 03:15	1
4-Methyl-2-pentanone (MIBK)	10	*+ U	10	2.1	ug/L			12/09/22 03:15	1
Acetone	10	U	10	3.0	ug/L			12/09/22 03:15	1
Benzene	10	U	10	0.41	ug/L			12/09/22 03:15	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/09/22 03:15	1
Bromoform	10	U	10	0.26	ug/L			12/09/22 03:15	1
Bromomethane	10	U	10	0.69	ug/L			12/09/22 03:15	1
Carbon disulfide	10	U	10	0.19	ug/L			12/09/22 03:15	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/09/22 03:15	1
Chlorobenzene	10	U	10	0.75	ug/L			12/09/22 03:15	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/09/22 03:15	1
Chloroethane	10	U	10	0.32	ug/L			12/09/22 03:15	1
Chloroform	10	U	10	0.34	ug/L			12/09/22 03:15	1
Chloromethane	10	U	10	0.35	ug/L			12/09/22 03:15	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/09/22 03:15	1
Ethylbenzene	10	U	10	0.74	ug/L			12/09/22 03:15	1
Methylene Chloride	10	U	10	0.44	ug/L			12/09/22 03:15	1
Styrene	10	U	10	0.73	ug/L			12/09/22 03:15	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/09/22 03:15	1
Toluene	10	U	10	0.51	ug/L			12/09/22 03:15	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/09/22 03:15	1
Trichloroethene	10	U	10	0.46	ug/L			12/09/22 03:15	1
Vinyl chloride	10	U	10	0.90	ug/L			12/09/22 03:15	1
Xylenes, Total	10	U	10	0.66	ug/L			12/09/22 03:15	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/09/22 03:15	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	107		77 - 120		12/09/22 03:15	1
Toluene-d8 (Surr)	92		80 - 120		12/09/22 03:15	1
4-Bromofluorobenzene (Surr)	88		73 - 120		12/09/22 03:15	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/15/22 16:42	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/15/22 16:42	1
Lead	9.9		3.0		ug/L		12/08/22 09:11	12/15/22 16:42	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 01:54	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 01:54	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 01:54	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-6A

Lab Sample ID: 480-204477-10

Date Collected: 12/06/22 08:41

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/09/22 03:36	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/09/22 03:36	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/09/22 03:36	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/09/22 03:36	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/09/22 03:36	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/09/22 03:36	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/09/22 03:36	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/09/22 03:36	1
2-Hexanone	10	*+ U	10	1.2	ug/L			12/09/22 03:36	1
4-Methyl-2-pentanone (MIBK)	10	*+ U	10	2.1	ug/L			12/09/22 03:36	1
Acetone	10	U	10	3.0	ug/L			12/09/22 03:36	1
Benzene	10	U	10	0.41	ug/L			12/09/22 03:36	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/09/22 03:36	1
Bromoform	10	U	10	0.26	ug/L			12/09/22 03:36	1
Bromomethane	10	U	10	0.69	ug/L			12/09/22 03:36	1
Carbon disulfide	10	U	10	0.19	ug/L			12/09/22 03:36	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/09/22 03:36	1
Chlorobenzene	10	U	10	0.75	ug/L			12/09/22 03:36	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/09/22 03:36	1
Chloroethane	10	U	10	0.32	ug/L			12/09/22 03:36	1
Chloroform	10	U	10	0.34	ug/L			12/09/22 03:36	1
Chloromethane	10	U	10	0.35	ug/L			12/09/22 03:36	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/09/22 03:36	1
Ethylbenzene	10	U	10	0.74	ug/L			12/09/22 03:36	1
Methylene Chloride	10	U	10	0.44	ug/L			12/09/22 03:36	1
Styrene	10	U	10	0.73	ug/L			12/09/22 03:36	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/09/22 03:36	1
Toluene	10	U	10	0.51	ug/L			12/09/22 03:36	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/09/22 03:36	1
Trichloroethene	16		10	0.46	ug/L			12/09/22 03:36	1
Vinyl chloride	10	U	10	0.90	ug/L			12/09/22 03:36	1
Xylenes, Total	10	U	10	0.66	ug/L			12/09/22 03:36	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/09/22 03:36	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	108		77 - 120		12/09/22 03:36	1
Toluene-d8 (Surr)	92		80 - 120		12/09/22 03:36	1
4-Bromofluorobenzene (Surr)	87		73 - 120		12/09/22 03:36	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/15/22 16:57	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/15/22 16:57	1
Lead	3.0	U	3.0		ug/L		12/08/22 09:11	12/15/22 16:57	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 01:58	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 01:58	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 01:58	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-6DA

Lab Sample ID: 480-204477-11

Date Collected: 12/06/22 09:00

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/09/22 03:58	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/09/22 03:58	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/09/22 03:58	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/09/22 03:58	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/09/22 03:58	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/09/22 03:58	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/09/22 03:58	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/09/22 03:58	1
2-Hexanone	10	*+ U	10	1.2	ug/L			12/09/22 03:58	1
4-Methyl-2-pentanone (MIBK)	10	*+ U	10	2.1	ug/L			12/09/22 03:58	1
Acetone	10	U	10	3.0	ug/L			12/09/22 03:58	1
Benzene	10	U	10	0.41	ug/L			12/09/22 03:58	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/09/22 03:58	1
Bromoform	10	U	10	0.26	ug/L			12/09/22 03:58	1
Bromomethane	10	U	10	0.69	ug/L			12/09/22 03:58	1
Carbon disulfide	10	U	10	0.19	ug/L			12/09/22 03:58	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/09/22 03:58	1
Chlorobenzene	10	U	10	0.75	ug/L			12/09/22 03:58	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/09/22 03:58	1
Chloroethane	10	U	10	0.32	ug/L			12/09/22 03:58	1
Chloroform	10	U	10	0.34	ug/L			12/09/22 03:58	1
Chloromethane	10	U	10	0.35	ug/L			12/09/22 03:58	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/09/22 03:58	1
Ethylbenzene	10	U	10	0.74	ug/L			12/09/22 03:58	1
Methylene Chloride	10	U	10	0.44	ug/L			12/09/22 03:58	1
Styrene	10	U	10	0.73	ug/L			12/09/22 03:58	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/09/22 03:58	1
Toluene	10	U	10	0.51	ug/L			12/09/22 03:58	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/09/22 03:58	1
Trichloroethene	10	U	10	0.46	ug/L			12/09/22 03:58	1
Vinyl chloride	10	U	10	0.90	ug/L			12/09/22 03:58	1
Xylenes, Total	10	U	10	0.66	ug/L			12/09/22 03:58	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/09/22 03:58	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	107		77 - 120		12/09/22 03:58	1
Toluene-d8 (Surr)	91		80 - 120		12/09/22 03:58	1
4-Bromofluorobenzene (Surr)	86		73 - 120		12/09/22 03:58	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/15/22 17:01	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/15/22 17:01	1
Lead	4.9		3.0		ug/L		12/08/22 09:11	12/15/22 17:01	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 02:01	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 02:01	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 02:01	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-7

Lab Sample ID: 480-204477-12

Date Collected: 12/05/22 13:14

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/09/22 04:20	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/09/22 04:20	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/09/22 04:20	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/09/22 04:20	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/09/22 04:20	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/09/22 04:20	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/09/22 04:20	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/09/22 04:20	1
2-Hexanone	10	*+ U	10	1.2	ug/L			12/09/22 04:20	1
4-Methyl-2-pentanone (MIBK)	10	*+ U	10	2.1	ug/L			12/09/22 04:20	1
Acetone	10	U	10	3.0	ug/L			12/09/22 04:20	1
Benzene	10	U	10	0.41	ug/L			12/09/22 04:20	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/09/22 04:20	1
Bromoform	10	U	10	0.26	ug/L			12/09/22 04:20	1
Bromomethane	10	U	10	0.69	ug/L			12/09/22 04:20	1
Carbon disulfide	10	U	10	0.19	ug/L			12/09/22 04:20	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/09/22 04:20	1
Chlorobenzene	10	U	10	0.75	ug/L			12/09/22 04:20	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/09/22 04:20	1
Chloroethane	10	U	10	0.32	ug/L			12/09/22 04:20	1
Chloroform	10	U	10	0.34	ug/L			12/09/22 04:20	1
Chloromethane	0.35	J	10	0.35	ug/L			12/09/22 04:20	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/09/22 04:20	1
Ethylbenzene	10	U	10	0.74	ug/L			12/09/22 04:20	1
Methylene Chloride	10	U	10	0.44	ug/L			12/09/22 04:20	1
Styrene	10	U	10	0.73	ug/L			12/09/22 04:20	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/09/22 04:20	1
Toluene	10	U	10	0.51	ug/L			12/09/22 04:20	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/09/22 04:20	1
Trichloroethene	10	U	10	0.46	ug/L			12/09/22 04:20	1
Vinyl chloride	10	U	10	0.90	ug/L			12/09/22 04:20	1
Xylenes, Total	10	U	10	0.66	ug/L			12/09/22 04:20	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/09/22 04:20	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	107		77 - 120		12/09/22 04:20	1
Toluene-d8 (Surr)	94		80 - 120		12/09/22 04:20	1
4-Bromofluorobenzene (Surr)	89		73 - 120		12/09/22 04:20	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/15/22 17:05	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/15/22 17:05	1
Lead	3.0	U	3.0		ug/L		12/08/22 09:11	12/15/22 17:05	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 02:05	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 02:05	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 02:05	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-9

Lab Sample ID: 480-204477-13

Date Collected: 12/02/22 13:22

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/08/22 07:44	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/08/22 07:44	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/08/22 07:44	1
1,1-Dichloroethane	0.56	J	10	0.38	ug/L			12/08/22 07:44	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/08/22 07:44	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/08/22 07:44	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/08/22 07:44	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/08/22 07:44	1
2-Hexanone	10	U	10	1.2	ug/L			12/08/22 07:44	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			12/08/22 07:44	1
Acetone	10	U	10	3.0	ug/L			12/08/22 07:44	1
Benzene	10	U	10	0.41	ug/L			12/08/22 07:44	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/08/22 07:44	1
Bromoform	10	U	10	0.26	ug/L			12/08/22 07:44	1
Bromomethane	10	U	10	0.69	ug/L			12/08/22 07:44	1
Carbon disulfide	10	U	10	0.19	ug/L			12/08/22 07:44	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/08/22 07:44	1
Chlorobenzene	10	U	10	0.75	ug/L			12/08/22 07:44	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/08/22 07:44	1
Chloroethane	10	U	10	0.32	ug/L			12/08/22 07:44	1
Chloroform	10	U	10	0.34	ug/L			12/08/22 07:44	1
Chloromethane	10	U	10	0.35	ug/L			12/08/22 07:44	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/08/22 07:44	1
Ethylbenzene	10	U	10	0.74	ug/L			12/08/22 07:44	1
Methylene Chloride	10	U	10	0.44	ug/L			12/08/22 07:44	1
Styrene	10	U	10	0.73	ug/L			12/08/22 07:44	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/08/22 07:44	1
Toluene	10	U	10	0.51	ug/L			12/08/22 07:44	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/08/22 07:44	1
Trichloroethene	5.9	J	10	0.46	ug/L			12/08/22 07:44	1
Vinyl chloride	10	U	10	0.90	ug/L			12/08/22 07:44	1
Xylenes, Total	10	U	10	0.66	ug/L			12/08/22 07:44	1
1,2-Dichloroethene, Total	2.6	J	10	0.81	ug/L			12/08/22 07:44	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	108		77 - 120		12/08/22 07:44	1
Toluene-d8 (Surr)	98		80 - 120		12/08/22 07:44	1
4-Bromofluorobenzene (Surr)	98		73 - 120		12/08/22 07:44	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/15/22 17:09	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/15/22 17:09	1
Lead	3.7		3.0		ug/L		12/08/22 09:11	12/15/22 17:09	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 02:09	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 02:09	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 02:09	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-9D

Lab Sample ID: 480-204477-14

Date Collected: 12/02/22 14:29

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/08/22 08:08	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/08/22 08:08	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/08/22 08:08	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/08/22 08:08	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/08/22 08:08	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/08/22 08:08	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/08/22 08:08	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/08/22 08:08	1
2-Hexanone	10	U	10	1.2	ug/L			12/08/22 08:08	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			12/08/22 08:08	1
Acetone	10	U	10	3.0	ug/L			12/08/22 08:08	1
Benzene	10	U	10	0.41	ug/L			12/08/22 08:08	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/08/22 08:08	1
Bromoform	10	U	10	0.26	ug/L			12/08/22 08:08	1
Bromomethane	10	U	10	0.69	ug/L			12/08/22 08:08	1
Carbon disulfide	10	U	10	0.19	ug/L			12/08/22 08:08	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/08/22 08:08	1
Chlorobenzene	10	U	10	0.75	ug/L			12/08/22 08:08	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/08/22 08:08	1
Chloroethane	10	U	10	0.32	ug/L			12/08/22 08:08	1
Chloroform	10	U	10	0.34	ug/L			12/08/22 08:08	1
Chloromethane	10	U	10	0.35	ug/L			12/08/22 08:08	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/08/22 08:08	1
Ethylbenzene	10	U	10	0.74	ug/L			12/08/22 08:08	1
Methylene Chloride	10	U	10	0.44	ug/L			12/08/22 08:08	1
Styrene	10	U	10	0.73	ug/L			12/08/22 08:08	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/08/22 08:08	1
Toluene	10	U	10	0.51	ug/L			12/08/22 08:08	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/08/22 08:08	1
Trichloroethene	10	U	10	0.46	ug/L			12/08/22 08:08	1
Vinyl chloride	10	U	10	0.90	ug/L			12/08/22 08:08	1
Xylenes, Total	10	U	10	0.66	ug/L			12/08/22 08:08	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/08/22 08:08	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	105		77 - 120		12/08/22 08:08	1
Toluene-d8 (Surr)	95		80 - 120		12/08/22 08:08	1
4-Bromofluorobenzene (Surr)	95		73 - 120		12/08/22 08:08	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/15/22 17:12	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/15/22 17:12	1
Lead	7.8		3.0		ug/L		12/08/22 09:11	12/15/22 17:12	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 02:13	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 02:13	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 02:13	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: TRIP BLANK

Lab Sample ID: 480-204477-15

Date Collected: 12/06/22 09:30

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/09/22 04:42	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/09/22 04:42	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/09/22 04:42	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/09/22 04:42	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/09/22 04:42	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/09/22 04:42	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/09/22 04:42	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/09/22 04:42	1
2-Hexanone	10	*+ U	10	1.2	ug/L			12/09/22 04:42	1
4-Methyl-2-pentanone (MIBK)	10	*+ U	10	2.1	ug/L			12/09/22 04:42	1
Acetone	10	U	10	3.0	ug/L			12/09/22 04:42	1
Benzene	10	U	10	0.41	ug/L			12/09/22 04:42	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/09/22 04:42	1
Bromoform	10	U	10	0.26	ug/L			12/09/22 04:42	1
Bromomethane	10	U	10	0.69	ug/L			12/09/22 04:42	1
Carbon disulfide	10	U	10	0.19	ug/L			12/09/22 04:42	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/09/22 04:42	1
Chlorobenzene	10	U	10	0.75	ug/L			12/09/22 04:42	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/09/22 04:42	1
Chloroethane	10	U	10	0.32	ug/L			12/09/22 04:42	1
Chloroform	10	U	10	0.34	ug/L			12/09/22 04:42	1
Chloromethane	10	U	10	0.35	ug/L			12/09/22 04:42	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/09/22 04:42	1
Ethylbenzene	10	U	10	0.74	ug/L			12/09/22 04:42	1
Methylene Chloride	10	U	10	0.44	ug/L			12/09/22 04:42	1
Styrene	10	U	10	0.73	ug/L			12/09/22 04:42	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/09/22 04:42	1
Toluene	10	U	10	0.51	ug/L			12/09/22 04:42	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/09/22 04:42	1
Trichloroethene	10	U	10	0.46	ug/L			12/09/22 04:42	1
Vinyl chloride	10	U	10	0.90	ug/L			12/09/22 04:42	1
Xylenes, Total	10	U	10	0.66	ug/L			12/09/22 04:42	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/09/22 04:42	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	108		77 - 120		12/09/22 04:42	1
Toluene-d8 (Surr)	91		80 - 120		12/09/22 04:42	1
4-Bromofluorobenzene (Surr)	86		73 - 120		12/09/22 04:42	1

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: Dup

Lab Sample ID: 480-204477-16

Date Collected: 12/05/22 12:16

Matrix: Ground Water

Date Received: 12/06/22 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/09/22 05:04	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/09/22 05:04	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/09/22 05:04	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/09/22 05:04	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/09/22 05:04	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/09/22 05:04	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/09/22 05:04	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/09/22 05:04	1
2-Hexanone	10	*+ U	10	1.2	ug/L			12/09/22 05:04	1
4-Methyl-2-pentanone (MIBK)	10	*+ U	10	2.1	ug/L			12/09/22 05:04	1
Acetone	10	U	10	3.0	ug/L			12/09/22 05:04	1
Benzene	10	U	10	0.41	ug/L			12/09/22 05:04	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/09/22 05:04	1
Bromoform	10	U	10	0.26	ug/L			12/09/22 05:04	1
Bromomethane	10	U	10	0.69	ug/L			12/09/22 05:04	1
Carbon disulfide	10	U	10	0.19	ug/L			12/09/22 05:04	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/09/22 05:04	1
Chlorobenzene	10	U	10	0.75	ug/L			12/09/22 05:04	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/09/22 05:04	1
Chloroethane	10	U	10	0.32	ug/L			12/09/22 05:04	1
Chloroform	10	U	10	0.34	ug/L			12/09/22 05:04	1
Chloromethane	10	U	10	0.35	ug/L			12/09/22 05:04	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/09/22 05:04	1
Ethylbenzene	10	U	10	0.74	ug/L			12/09/22 05:04	1
Methylene Chloride	10	U	10	0.44	ug/L			12/09/22 05:04	1
Styrene	10	U	10	0.73	ug/L			12/09/22 05:04	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/09/22 05:04	1
Toluene	10	U	10	0.51	ug/L			12/09/22 05:04	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/09/22 05:04	1
Trichloroethene	0.60	J	10	0.46	ug/L			12/09/22 05:04	1
Vinyl chloride	10	U	10	0.90	ug/L			12/09/22 05:04	1
Xylenes, Total	10	U	10	0.66	ug/L			12/09/22 05:04	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/09/22 05:04	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	109		77 - 120		12/09/22 05:04	1
Toluene-d8 (Surr)	92		80 - 120		12/09/22 05:04	1
4-Bromofluorobenzene (Surr)	87		73 - 120		12/09/22 05:04	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/15/22 17:16	1
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/15/22 17:16	1
Lead	3.0	U	3.0		ug/L		12/08/22 09:11	12/15/22 17:16	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 02:17	1
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 02:17	1
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 02:17	1

Eurofins Buffalo

Surrogate Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Method: 8260C - Volatile Organic Compounds by GC/MS

Matrix: Ground Water

Prep Type: Total/NA

Lab Sample ID	Client Sample ID	Percent Surrogate Recovery (Acceptance Limits)		
		DCA (77-120)	TOL (80-120)	BFB (73-120)
480-204477-1	MW-1	104	100	102
480-204477-2	MW-11	107	92	87
480-204477-2 MS	MW-11	108	97	87
480-204477-2 MSD	MW-11	104	95	87
480-204477-3	MW-12	106	99	102
480-204477-4	MW-13	111	100	98
480-204477-5	MW-14	107	92	87
480-204477-6	MW-1DA	107	97	97
480-204477-7	MW-2A	107	92	88
480-204477-8	MW-3	107	93	88
480-204477-9	MW-5	107	92	88
480-204477-10	MW-6A	108	92	87
480-204477-11	MW-6DA	107	91	86
480-204477-12	MW-7	107	94	89
480-204477-13	MW-9	108	98	98
480-204477-14	MW-9D	105	95	95
480-204477-15	TRIP BLANK	108	91	86
480-204477-16	Dup	109	92	87
Surrogate Legend				
DCA = 1,2-Dichloroethane-d4 (Surr)				
TOL = Toluene-d8 (Surr)				
BFB = 4-Bromofluorobenzene (Surr)				

Method: 8260C - Volatile Organic Compounds by GC/MS

Matrix: Water

Prep Type: Total/NA

Lab Sample ID	Client Sample ID	Percent Surrogate Recovery (Acceptance Limits)		
		DCA (77-120)	TOL (80-120)	BFB (73-120)
LCS 480-652557/6	Lab Control Sample	106	98	103
LCS 480-652688/6	Lab Control Sample	106	94	86
MB 480-652557/8	Method Blank	106	98	97
MB 480-652688/8	Method Blank	108	92	88
Surrogate Legend				
DCA = 1,2-Dichloroethane-d4 (Surr)				
TOL = Toluene-d8 (Surr)				
BFB = 4-Bromofluorobenzene (Surr)				

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Method: 8260C - Volatile Organic Compounds by GC/MS

Lab Sample ID: MB 480-652557/8

Matrix: Water

Analysis Batch: 652557

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/08/22 00:22	1
1,1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/08/22 00:22	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/08/22 00:22	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/08/22 00:22	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/08/22 00:22	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/08/22 00:22	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/08/22 00:22	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/08/22 00:22	1
2-Hexanone	10	U	10	1.2	ug/L			12/08/22 00:22	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			12/08/22 00:22	1
Acetone	10	U	10	3.0	ug/L			12/08/22 00:22	1
Benzene	10	U	10	0.41	ug/L			12/08/22 00:22	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/08/22 00:22	1
Bromoform	10	U	10	0.26	ug/L			12/08/22 00:22	1
Bromomethane	10	U	10	0.69	ug/L			12/08/22 00:22	1
Carbon disulfide	10	U	10	0.19	ug/L			12/08/22 00:22	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/08/22 00:22	1
Chlorobenzene	10	U	10	0.75	ug/L			12/08/22 00:22	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/08/22 00:22	1
Chloroethane	10	U	10	0.32	ug/L			12/08/22 00:22	1
Chloroform	10	U	10	0.34	ug/L			12/08/22 00:22	1
Chloromethane	10	U	10	0.35	ug/L			12/08/22 00:22	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/08/22 00:22	1
Ethylbenzene	10	U	10	0.74	ug/L			12/08/22 00:22	1
Methylene Chloride	10	U	10	0.44	ug/L			12/08/22 00:22	1
Styrene	10	U	10	0.73	ug/L			12/08/22 00:22	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/08/22 00:22	1
Toluene	10	U	10	0.51	ug/L			12/08/22 00:22	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/08/22 00:22	1
Trichloroethene	10	U	10	0.46	ug/L			12/08/22 00:22	1
Vinyl chloride	10	U	10	0.90	ug/L			12/08/22 00:22	1
Xylenes, Total	10	U	10	0.66	ug/L			12/08/22 00:22	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/08/22 00:22	1

Surrogate	MB %Recovery	MB Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	106		77 - 120		12/08/22 00:22	1
Toluene-d8 (Surr)	98		80 - 120		12/08/22 00:22	1
4-Bromofluorobenzene (Surr)	97		73 - 120		12/08/22 00:22	1

Lab Sample ID: LCS 480-652557/6

Matrix: Water

Analysis Batch: 652557

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
1,1-Dichloroethane	25.0	23.9		ug/L		96	77 - 120
Benzene	25.0	24.9		ug/L		100	71 - 124
Chlorobenzene	25.0	24.2		ug/L		97	80 - 120
Toluene	25.0	24.0		ug/L		96	80 - 122

Eurofins Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Method: 8260C - Volatile Organic Compounds by GC/MS (Continued)

Lab Sample ID: LCS 480-652557/6

Matrix: Water

Analysis Batch: 652557

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Trichloroethene	25.0	25.1		ug/L		101	74 - 123

Surrogate	LCS %Recovery	LCS Qualifier	Limits
1,2-Dichloroethane-d4 (Surr)	106		77 - 120
Toluene-d8 (Surr)	98		80 - 120
4-Bromofluorobenzene (Surr)	103		73 - 120

Lab Sample ID: MB 480-652688/8

Matrix: Water

Analysis Batch: 652688

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			12/09/22 01:03	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			12/09/22 01:03	1
1,1,1,2-Trichloroethane	10	U	10	0.23	ug/L			12/09/22 01:03	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			12/09/22 01:03	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			12/09/22 01:03	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			12/09/22 01:03	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			12/09/22 01:03	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			12/09/22 01:03	1
2-Hexanone	10	U	10	1.2	ug/L			12/09/22 01:03	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			12/09/22 01:03	1
Acetone	10	U	10	3.0	ug/L			12/09/22 01:03	1
Benzene	10	U	10	0.41	ug/L			12/09/22 01:03	1
Bromodichloromethane	10	U	10	0.39	ug/L			12/09/22 01:03	1
Bromoform	10	U	10	0.26	ug/L			12/09/22 01:03	1
Bromomethane	10	U	10	0.69	ug/L			12/09/22 01:03	1
Carbon disulfide	10	U	10	0.19	ug/L			12/09/22 01:03	1
Carbon tetrachloride	10	U	10	0.27	ug/L			12/09/22 01:03	1
Chlorobenzene	10	U	10	0.75	ug/L			12/09/22 01:03	1
Dibromochloromethane	10	U	10	0.32	ug/L			12/09/22 01:03	1
Chloroethane	10	U	10	0.32	ug/L			12/09/22 01:03	1
Chloroform	10	U	10	0.34	ug/L			12/09/22 01:03	1
Chloromethane	10	U	10	0.35	ug/L			12/09/22 01:03	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			12/09/22 01:03	1
Ethylbenzene	10	U	10	0.74	ug/L			12/09/22 01:03	1
Methylene Chloride	10	U	10	0.44	ug/L			12/09/22 01:03	1
Styrene	10	U	10	0.73	ug/L			12/09/22 01:03	1
Tetrachloroethene	10	U	10	0.36	ug/L			12/09/22 01:03	1
Toluene	10	U	10	0.51	ug/L			12/09/22 01:03	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			12/09/22 01:03	1
Trichloroethene	10	U	10	0.46	ug/L			12/09/22 01:03	1
Vinyl chloride	10	U	10	0.90	ug/L			12/09/22 01:03	1
Xylenes, Total	10	U	10	0.66	ug/L			12/09/22 01:03	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			12/09/22 01:03	1

Surrogate	MB %Recovery	MB Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	108		77 - 120		12/09/22 01:03	1

Eurofins Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Method: 8260C - Volatile Organic Compounds by GC/MS (Continued)

Lab Sample ID: MB 480-652688/8

Matrix: Water

Analysis Batch: 652688

Client Sample ID: Method Blank

Prep Type: Total/NA

Surrogate	MB %Recovery	MB Qualifier	Limits	Prepared	Analyzed	Dil Fac
Toluene-d8 (Surr)	92		80 - 120		12/09/22 01:03	1
4-Bromofluorobenzene (Surr)	88		73 - 120		12/09/22 01:03	1

Lab Sample ID: LCS 480-652688/6

Matrix: Water

Analysis Batch: 652688

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
1,1-Dichloroethane	25.0	24.4		ug/L		97	77 - 120
Benzene	25.0	22.8		ug/L		91	71 - 124
Chlorobenzene	25.0	22.7		ug/L		91	80 - 120
Toluene	25.0	23.5		ug/L		94	80 - 122
Trichloroethene	25.0	23.6		ug/L		94	74 - 123

Surrogate	LCS %Recovery	LCS Qualifier	Limits
1,2-Dichloroethane-d4 (Surr)	106		77 - 120
Toluene-d8 (Surr)	94		80 - 120
4-Bromofluorobenzene (Surr)	86		73 - 120

Lab Sample ID: 480-204477-2 MS

Matrix: Ground Water

Analysis Batch: 652688

Client Sample ID: MW-11

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
1,1-Dichloroethane	10		25.0	23.8		ug/L		95	77 - 120
Benzene	10		25.0	22.5		ug/L		90	71 - 124
Chlorobenzene	10		25.0	22.6		ug/L		91	80 - 120
Toluene	10		25.0	23.1		ug/L		92	80 - 122
Trichloroethene	10		25.0	23.1		ug/L		92	74 - 123

Surrogate	MS %Recovery	MS Qualifier	Limits
1,2-Dichloroethane-d4 (Surr)	108		77 - 120
Toluene-d8 (Surr)	97		80 - 120
4-Bromofluorobenzene (Surr)	87		73 - 120

Lab Sample ID: 480-204477-2 MSD

Matrix: Ground Water

Analysis Batch: 652688

Client Sample ID: MW-11

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	Limit
1,1-Dichloroethane	10		25.0	25.6		ug/L		102	77 - 120	7	20
Benzene	10		25.0	24.1		ug/L		97	71 - 124	7	13
Chlorobenzene	10		25.0	24.4		ug/L		98	80 - 120	8	25
Toluene	10		25.0	24.9		ug/L		99	80 - 122	7	15
Trichloroethene	10		25.0	25.3		ug/L		101	74 - 123	9	16

Eurofins Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Method: 8260C - Volatile Organic Compounds by GC/MS (Continued)

Lab Sample ID: 480-204477-2 MSD

Matrix: Ground Water

Analysis Batch: 652688

Client Sample ID: MW-11

Prep Type: Total/NA

	MSD	MSD	
Surrogate	%Recovery	Qualifier	Limits
1,2-Dichloroethane-d4 (Surr)	104		77 - 120
Toluene-d8 (Surr)	95		80 - 120
4-Bromofluorobenzene (Surr)	87		73 - 120

Method: 6010C - Metals (ICP)

Lab Sample ID: MB 480-652544/1-A

Matrix: Water

Analysis Batch: 653046

Client Sample ID: Method Blank

Prep Type: Total/NA

Prep Batch: 652544

Analyte	MB	MB								
	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil	Fac
Cadmium	5.0	U	5.0		ug/L		12/08/22 09:11	12/09/22 21:46	1	
Chromium	10.0	U	10.0		ug/L		12/08/22 09:11	12/09/22 21:46	1	
Lead	3.0	U	3.0		ug/L		12/08/22 09:11	12/09/22 21:46	1	

Lab Sample ID: LCS 480-652544/2-A

Matrix: Water

Analysis Batch: 653046

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Prep Batch: 652544

Analyte	Spike	LCS	LCS					%Rec		
	Added	Result	Qualifier	Unit	D	%Rec	Limits			
Cadmium	200	205.8		ug/L		103	80 - 120			
Chromium	200	208.9		ug/L		104	80 - 120			
Lead	200	210.0		ug/L		105	80 - 120			

Lab Sample ID: 480-204477-2 MS

Matrix: Ground Water

Analysis Batch: 653046

Client Sample ID: MW-11

Prep Type: Total/NA

Prep Batch: 652544

Analyte	Sample	Sample	Spike	MS	MS				%Rec	
	Result	Qualifier	Added	Result	Qualifier	Unit	D	%Rec	Limits	
Cadmium	5.0		200	208.1		ug/L		104	75 - 125	
Chromium	10.0		200	205.4		ug/L		103	75 - 125	
Lead	3.0		200	211.2		ug/L		106	75 - 125	

Lab Sample ID: 480-204477-2 MSD

Matrix: Ground Water

Analysis Batch: 653046

Client Sample ID: MW-11

Prep Type: Total/NA

Prep Batch: 652544

Analyte	Sample	Sample	Spike	MSD	MSD				%Rec	RPD	
	Result	Qualifier	Added	Result	Qualifier	Unit	D	%Rec	Limits	RPD	Limit
Cadmium	5.0		200	206.2		ug/L		103	75 - 125	1	20
Chromium	10.0		200	205.3		ug/L		103	75 - 125	0	20
Lead	3.0		200	213.5		ug/L		107	75 - 125	1	20

Lab Sample ID: MB 480-652542/1-A

Matrix: Water

Analysis Batch: 653020

Client Sample ID: Method Blank

Prep Type: Total Recoverable

Prep Batch: 652542

Analyte	MB	MB								
	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil	Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		12/08/22 09:04	12/10/22 00:33	1	
Chromium, Dissolved	10.0	U	10.0		ug/L		12/08/22 09:04	12/10/22 00:33	1	
Lead, Dissolved	3.0	U	3.0		ug/L		12/08/22 09:04	12/10/22 00:33	1	

Eurofins Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Method: 6010C - Metals (ICP)

Lab Sample ID: LCS 480-652542/2-A
Matrix: Water
Analysis Batch: 653020

Client Sample ID: Lab Control Sample
Prep Type: Total Recoverable
Prep Batch: 652542

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Cadmium, Dissolved	200	204.8		ug/L		102	80 - 120
Chromium, Dissolved	200	198.3		ug/L		99	80 - 120
Lead, Dissolved	200	212.6		ug/L		106	80 - 120

Lab Sample ID: 480-204477-2 MS
Matrix: Ground Water
Analysis Batch: 653020

Client Sample ID: MW-11
Prep Type: Dissolved
Prep Batch: 652542

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Cadmium, Dissolved	5.0		200	209.4		ug/L		105	75 - 125
Chromium, Dissolved	10.0		200	199.2		ug/L		100	75 - 125
Lead, Dissolved	3.0		200	217.3		ug/L		109	75 - 125

Lab Sample ID: 480-204477-2 MSD
Matrix: Ground Water
Analysis Batch: 653020

Client Sample ID: MW-11
Prep Type: Dissolved
Prep Batch: 652542

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Cadmium, Dissolved	5.0		200	207.1		ug/L		104	75 - 125	1	20
Chromium, Dissolved	10.0		200	198.1		ug/L		99	75 - 125	1	20
Lead, Dissolved	3.0		200	214.6		ug/L		107	75 - 125	1	20

QC Association Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

GC/MS VOA

Analysis Batch: 652557

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-204477-1	MW-1	Total/NA	Ground Water	8260C	
480-204477-3	MW-12	Total/NA	Ground Water	8260C	
480-204477-4	MW-13	Total/NA	Ground Water	8260C	
480-204477-6	MW-1DA	Total/NA	Ground Water	8260C	
480-204477-13	MW-9	Total/NA	Ground Water	8260C	
480-204477-14	MW-9D	Total/NA	Ground Water	8260C	
MB 480-652557/8	Method Blank	Total/NA	Water	8260C	
LCS 480-652557/6	Lab Control Sample	Total/NA	Water	8260C	

Analysis Batch: 652688

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-204477-2	MW-11	Total/NA	Ground Water	8260C	
480-204477-5	MW-14	Total/NA	Ground Water	8260C	
480-204477-7	MW-2A	Total/NA	Ground Water	8260C	
480-204477-8	MW-3	Total/NA	Ground Water	8260C	
480-204477-9	MW-5	Total/NA	Ground Water	8260C	
480-204477-10	MW-6A	Total/NA	Ground Water	8260C	
480-204477-11	MW-6DA	Total/NA	Ground Water	8260C	
480-204477-12	MW-7	Total/NA	Ground Water	8260C	
480-204477-15	TRIP BLANK	Total/NA	Ground Water	8260C	
480-204477-16	Dup	Total/NA	Ground Water	8260C	
MB 480-652688/8	Method Blank	Total/NA	Water	8260C	
LCS 480-652688/6	Lab Control Sample	Total/NA	Water	8260C	
480-204477-2 MS	MW-11	Total/NA	Ground Water	8260C	
480-204477-2 MSD	MW-11	Total/NA	Ground Water	8260C	

Metals

Prep Batch: 652542

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-204477-1	MW-1	Dissolved	Ground Water	3005A	
480-204477-2	MW-11	Dissolved	Ground Water	3005A	
480-204477-3	MW-12	Dissolved	Ground Water	3005A	
480-204477-4	MW-13	Dissolved	Ground Water	3005A	
480-204477-5	MW-14	Dissolved	Ground Water	3005A	
480-204477-6	MW-1DA	Dissolved	Ground Water	3005A	
480-204477-7	MW-2A	Dissolved	Ground Water	3005A	
480-204477-8	MW-3	Dissolved	Ground Water	3005A	
480-204477-9	MW-5	Dissolved	Ground Water	3005A	
480-204477-10	MW-6A	Dissolved	Ground Water	3005A	
480-204477-11	MW-6DA	Dissolved	Ground Water	3005A	
480-204477-12	MW-7	Dissolved	Ground Water	3005A	
480-204477-13	MW-9	Dissolved	Ground Water	3005A	
480-204477-14	MW-9D	Dissolved	Ground Water	3005A	
480-204477-16	Dup	Dissolved	Ground Water	3005A	
MB 480-652542/1-A	Method Blank	Total Recoverable	Water	3005A	
LCS 480-652542/2-A	Lab Control Sample	Total Recoverable	Water	3005A	
480-204477-2 MS	MW-11	Dissolved	Ground Water	3005A	
480-204477-2 MSD	MW-11	Dissolved	Ground Water	3005A	

QC Association Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Metals

Prep Batch: 652544

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-204477-1	MW-1	Total/NA	Ground Water	3005A	
480-204477-2	MW-11	Total/NA	Ground Water	3005A	
480-204477-3	MW-12	Total/NA	Ground Water	3005A	
480-204477-4	MW-13	Total/NA	Ground Water	3005A	
480-204477-5	MW-14	Total/NA	Ground Water	3005A	
480-204477-6	MW-1DA	Total/NA	Ground Water	3005A	
480-204477-7	MW-2A	Total/NA	Ground Water	3005A	
480-204477-8	MW-3	Total/NA	Ground Water	3005A	
480-204477-9	MW-5	Total/NA	Ground Water	3005A	
480-204477-10	MW-6A	Total/NA	Ground Water	3005A	
480-204477-11	MW-6DA	Total/NA	Ground Water	3005A	
480-204477-12	MW-7	Total/NA	Ground Water	3005A	
480-204477-13	MW-9	Total/NA	Ground Water	3005A	
480-204477-14	MW-9D	Total/NA	Ground Water	3005A	
480-204477-16	Dup	Total/NA	Ground Water	3005A	
MB 480-652544/1-A	Method Blank	Total/NA	Water	3005A	
LCS 480-652544/2-A	Lab Control Sample	Total/NA	Water	3005A	
480-204477-2 MS	MW-11	Total/NA	Ground Water	3005A	
480-204477-2 MSD	MW-11	Total/NA	Ground Water	3005A	

Analysis Batch: 653020

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-204477-1	MW-1	Dissolved	Ground Water	6010C	652542
480-204477-2	MW-11	Dissolved	Ground Water	6010C	652542
480-204477-3	MW-12	Dissolved	Ground Water	6010C	652542
480-204477-4	MW-13	Dissolved	Ground Water	6010C	652542
480-204477-5	MW-14	Dissolved	Ground Water	6010C	652542
480-204477-6	MW-1DA	Dissolved	Ground Water	6010C	652542
480-204477-7	MW-2A	Dissolved	Ground Water	6010C	652542
480-204477-8	MW-3	Dissolved	Ground Water	6010C	652542
480-204477-9	MW-5	Dissolved	Ground Water	6010C	652542
480-204477-10	MW-6A	Dissolved	Ground Water	6010C	652542
480-204477-11	MW-6DA	Dissolved	Ground Water	6010C	652542
480-204477-12	MW-7	Dissolved	Ground Water	6010C	652542
480-204477-13	MW-9	Dissolved	Ground Water	6010C	652542
480-204477-14	MW-9D	Dissolved	Ground Water	6010C	652542
480-204477-16	Dup	Dissolved	Ground Water	6010C	652542
MB 480-652542/1-A	Method Blank	Total Recoverable	Water	6010C	652542
LCS 480-652542/2-A	Lab Control Sample	Total Recoverable	Water	6010C	652542
480-204477-2 MS	MW-11	Dissolved	Ground Water	6010C	652542
480-204477-2 MSD	MW-11	Dissolved	Ground Water	6010C	652542

Analysis Batch: 653046

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-204477-1	MW-1	Total/NA	Ground Water	6010C	652544
480-204477-2	MW-11	Total/NA	Ground Water	6010C	652544
MB 480-652544/1-A	Method Blank	Total/NA	Water	6010C	652544
LCS 480-652544/2-A	Lab Control Sample	Total/NA	Water	6010C	652544
480-204477-2 MS	MW-11	Total/NA	Ground Water	6010C	652544
480-204477-2 MSD	MW-11	Total/NA	Ground Water	6010C	652544

Eurofins Buffalo

QC Association Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Metals

Analysis Batch: 653735

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-204477-3	MW-12	Total/NA	Ground Water	6010C	652544
480-204477-4	MW-13	Total/NA	Ground Water	6010C	652544
480-204477-5	MW-14	Total/NA	Ground Water	6010C	652544
480-204477-6	MW-1DA	Total/NA	Ground Water	6010C	652544
480-204477-7	MW-2A	Total/NA	Ground Water	6010C	652544
480-204477-8	MW-3	Total/NA	Ground Water	6010C	652544
480-204477-9	MW-5	Total/NA	Ground Water	6010C	652544
480-204477-10	MW-6A	Total/NA	Ground Water	6010C	652544
480-204477-11	MW-6DA	Total/NA	Ground Water	6010C	652544
480-204477-12	MW-7	Total/NA	Ground Water	6010C	652544
480-204477-13	MW-9	Total/NA	Ground Water	6010C	652544
480-204477-14	MW-9D	Total/NA	Ground Water	6010C	652544
480-204477-16	Dup	Total/NA	Ground Water	6010C	652544

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-1

Lab Sample ID: 480-204477-1

Date Collected: 12/02/22 10:45

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652557	ATG	EET BUF	12/08/22 06:12
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 00:45
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653046	LMH	EET BUF	12/09/22 21:54

Client Sample ID: MW-11

Lab Sample ID: 480-204477-2

Date Collected: 12/05/22 10:59

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652688	AXK	EET BUF	12/09/22 01:47
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 01:00
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653046	LMH	EET BUF	12/09/22 21:58

Client Sample ID: MW-12

Lab Sample ID: 480-204477-3

Date Collected: 12/02/22 10:01

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652557	ATG	EET BUF	12/08/22 06:35
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 01:19
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653735	LMH	EET BUF	12/15/22 16:18

Client Sample ID: MW-13

Lab Sample ID: 480-204477-4

Date Collected: 12/02/22 08:41

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652557	ATG	EET BUF	12/08/22 06:58
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 01:23
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653735	LMH	EET BUF	12/15/22 16:22

Client Sample ID: MW-14

Lab Sample ID: 480-204477-5

Date Collected: 12/05/22 10:03

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652688	AXK	EET BUF	12/09/22 02:09

Eurofins Buffalo

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-14

Date Collected: 12/05/22 10:03

Date Received: 12/06/22 14:00

Lab Sample ID: 480-204477-5

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 01:27
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653735	LMH	EET BUF	12/15/22 16:26

Client Sample ID: MW-1DA

Date Collected: 12/02/22 11:59

Date Received: 12/06/22 14:00

Lab Sample ID: 480-204477-6

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652557	ATG	EET BUF	12/08/22 07:21
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 01:31
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653735	LMH	EET BUF	12/15/22 16:30

Client Sample ID: MW-2A

Date Collected: 12/05/22 14:12

Date Received: 12/06/22 14:00

Lab Sample ID: 480-204477-7

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652688	AXK	EET BUF	12/09/22 02:31
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 01:46
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653735	LMH	EET BUF	12/15/22 16:34

Client Sample ID: MW-3

Date Collected: 12/05/22 12:16

Date Received: 12/06/22 14:00

Lab Sample ID: 480-204477-8

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652688	AXK	EET BUF	12/09/22 02:53
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 01:50
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653735	LMH	EET BUF	12/15/22 16:38

Client Sample ID: MW-5

Date Collected: 12/05/22 14:55

Date Received: 12/06/22 14:00

Lab Sample ID: 480-204477-9

Matrix: Ground Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652688	AXK	EET BUF	12/09/22 03:15

Eurofins Buffalo

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-5

Lab Sample ID: 480-204477-9

Date Collected: 12/05/22 14:55

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 01:54
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653735	LMH	EET BUF	12/15/22 16:42

Client Sample ID: MW-6A

Lab Sample ID: 480-204477-10

Date Collected: 12/06/22 08:41

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652688	AXK	EET BUF	12/09/22 03:36
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 01:58
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653735	LMH	EET BUF	12/15/22 16:57

Client Sample ID: MW-6DA

Lab Sample ID: 480-204477-11

Date Collected: 12/06/22 09:00

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652688	AXK	EET BUF	12/09/22 03:58
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 02:01
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653735	LMH	EET BUF	12/15/22 17:01

Client Sample ID: MW-7

Lab Sample ID: 480-204477-12

Date Collected: 12/05/22 13:14

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652688	AXK	EET BUF	12/09/22 04:20
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 02:05
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653735	LMH	EET BUF	12/15/22 17:05

Client Sample ID: MW-9

Lab Sample ID: 480-204477-13

Date Collected: 12/02/22 13:22

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652557	ATG	EET BUF	12/08/22 07:44

Eurofins Buffalo

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Client Sample ID: MW-9

Lab Sample ID: 480-204477-13

Date Collected: 12/02/22 13:22

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 02:09
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653735	LMH	EET BUF	12/15/22 17:09

Client Sample ID: MW-9D

Lab Sample ID: 480-204477-14

Date Collected: 12/02/22 14:29

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652557	ATG	EET BUF	12/08/22 08:08
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 02:13
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653735	LMH	EET BUF	12/15/22 17:12

Client Sample ID: TRIP BLANK

Lab Sample ID: 480-204477-15

Date Collected: 12/06/22 09:30

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652688	AXK	EET BUF	12/09/22 04:42

Client Sample ID: Dup

Lab Sample ID: 480-204477-16

Date Collected: 12/05/22 12:16

Matrix: Ground Water

Date Received: 12/06/22 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	652688	AXK	EET BUF	12/09/22 05:04
Dissolved	Prep	3005A			652542	NVK	EET BUF	12/08/22 09:04
Dissolved	Analysis	6010C		1	653020	LMH	EET BUF	12/10/22 02:17
Total/NA	Prep	3005A			652544	NVK	EET BUF	12/08/22 09:11
Total/NA	Analysis	6010C		1	653735	LMH	EET BUF	12/15/22 17:16

Laboratory References:

EET BUF = Eurofins Buffalo, 10 Hazelwood Drive, Amherst, NY 14228-2298, TEL (716)691-2600

Accreditation/Certification Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Laboratory: Eurofins Buffalo

Unless otherwise noted, all analytes for this laboratory were covered under each accreditation/certification below.

Authority	Program	Identification Number	Expiration Date
New York	NELAP	10026	03-31-23

The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.

Analysis Method	Prep Method	Matrix	Analyte
8260C		Ground Water	1,2-Dichloroethene, Total

Method Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Method	Method Description	Protocol	Laboratory
8260C	Volatile Organic Compounds by GC/MS	SW846	EET BUF
6010C	Metals (ICP)	SW846	EET BUF
3005A	Preparation, Total Metals	SW846	EET BUF
3005A	Preparation, Total Recoverable or Dissolved Metals	SW846	EET BUF
5030C	Purge and Trap	SW846	EET BUF

Protocol References:

SW846 = "Test Methods For Evaluating Solid Waste, Physical/Chemical Methods", Third Edition, November 1986 And Its Updates.

Laboratory References:

EET BUF = Eurofins Buffalo, 10 Hazelwood Drive, Amherst, NY 14228-2298, TEL (716)691-2600

Sample Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

Lab Sample ID	Client Sample ID	Matrix	Collected	Received
480-204477-1	MW-1	Ground Water	12/02/22 10:45	12/06/22 14:00
480-204477-2	MW-11	Ground Water	12/05/22 10:59	12/06/22 14:00
480-204477-3	MW-12	Ground Water	12/02/22 10:01	12/06/22 14:00
480-204477-4	MW-13	Ground Water	12/02/22 08:41	12/06/22 14:00
480-204477-5	MW-14	Ground Water	12/05/22 10:03	12/06/22 14:00
480-204477-6	MW-1DA	Ground Water	12/02/22 11:59	12/06/22 14:00
480-204477-7	MW-2A	Ground Water	12/05/22 14:12	12/06/22 14:00
480-204477-8	MW-3	Ground Water	12/05/22 12:16	12/06/22 14:00
480-204477-9	MW-5	Ground Water	12/05/22 14:55	12/06/22 14:00
480-204477-10	MW-6A	Ground Water	12/06/22 08:41	12/06/22 14:00
480-204477-11	MW-6DA	Ground Water	12/06/22 09:00	12/06/22 14:00
480-204477-12	MW-7	Ground Water	12/05/22 13:14	12/06/22 14:00
480-204477-13	MW-9	Ground Water	12/02/22 13:22	12/06/22 14:00
480-204477-14	MW-9D	Ground Water	12/02/22 14:29	12/06/22 14:00
480-204477-15	TRIP BLANK	Ground Water	12/06/22 09:30	12/06/22 14:00
480-204477-16	Dup	Ground Water	12/05/22 12:16	12/06/22 14:00

Quantitation Limit Exceptions Summary


Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-204477-1

The requested project specific reporting limits listed below were less than laboratory standard quantitation limits (PQL) but greater than or equal to the laboratory method detection limits (MDL). It must be noted that results reported below lab standard quantitation limits may result in false positive/false negative values and less accurate quantitation. Routine laboratory procedures do not indicate corrective action for detections below the laboratory's PQL.

Method	Analyte	Matrix	Prep Type	Unit	Client RL	Lab PQL
6010C	Lead	Ground Water	Total/NA	ug/L	3.0	10
6010C	Lead, Dissolved	Ground Water	Dissolved	ug/L	3.0	10

Chain of Custody Record



Environment Testing

Client Information		Lab PM Fischer, Brian J		Carrier Tracking No(s)		COC No: 480-179552-19331.1	
Client Contact: Patrick Allenstein		Phone: ART KOSKE		State of Origin: NY		Page: Page 1 of 2	
Company: KPRG and Associates, Inc.		E-Mail: Brian.Fischer@et.eurofins.com		Job #:			
Address: 14665 West Lisbon Road, Suite 1A		PWSD:		Analysis Requested			
City: Brookfield		Due Date Requested:					
State, Zip: WI, 53005		TAT Requested (days): PER CONTRACT					
Phone: 262-781-0475(Tel)		Compliance Project: ☐ Yes ☒ No					
Email: patricka@kprginc.com		Purchase Order not required					
Project Name: Prestolite site/ Event Desc: Prestolite site		PO #:					
Site: New York		WO #:					
		Project #: 48002774					
		SSOW#:					

Sample Identification	Sample Date	Sample Time	Sample Type (C=Comp, G=grab)	Matrix (W=water, S=solid, O=wastefoil, BT=tissue, A=air)	Field Filtered Sample (Yes or No)	8260C - (MOD) Local Method	6010C - T. Cd/Cr/Pb (ICP)	6010C - D. Cd/Cr/Pb (ICP)	Preservation Code:	Special Instructions/Note:
MW-1	12-22-22	10:45	G	Water	X	X	X	X		
MW-11	12-5-22	10:59		Water	X	X	X	X		D. METALS
MW-12	12-2-22	10:01		Water	X	X	X	X		ARE FIELD
MW-13	12-2-22	8:41		Water	X	X	X	X		FILTERED
MW-14	12-5-22	10:03		Water	X	X	X	X		
MW-1DA	12-2-22	11:59		Water	X	X	X	X		
MW-2A	12-5-22	14:12		Water	X	X	X	X		
MW-3	12-5-22	12:16		Water	X	X	X	X		
MW-5	12-5-22	14:55		Water	X	X	X	X		
MW-6A	12-6-22	8:41		Water	X	X	X	X		
MW-6DA	12-6-22	9:00		Water	X	X	X	X		

Possible Hazard Identification ☒ Non-Hazard ☐ Flammable ☐ Skin Irritant Deliverable Requested: I, II, III, IV, Other (specify)		Sample Disposal (A fee may be assessed if samples are retained longer than 1 month) ☐ Return To Client ☒ Disposal By Lab ☐ Archive For _____ Months	
Empty Kit Relinquished by: Relinquished by: _____ Date: _____ Relinquished by: _____ Date: _____ Relinquished by: _____ Date: _____		Special Instructions/QC Requirements: Method of Shipment: _____ Received by: _____ Date/Time: _____ Received by: _____ Date/Time: _____ Received by: _____ Date/Time: _____	
Custody Seals Intact: ☐ Yes ☐ No ☐ Δ		Cooler Temperature(s) and Other Remarks: 12-6-22 1400 3.0 # 12-12	

Chain of Custody Record



Environment Testing

Client Information Client Contact: Patrick Allenstein Company: KPRG and Associates, Inc. Address: 14665 West Lisbon Road, Suite 1A City: Brookfield State, Zip: WI, 53005 Phone: 262-781-0475(Tel) Email: patricka@kprginc.com Project Name: Prestolite site/ Event Desc: Prestolite site Site: New York		Lab PM: Fischer, Brian J E-Mail: Brian.Fischer@et.eurofins.com Carrier Tracking No(s): State of Origin: NY Page: Page 2 of 2 Job #:		COC No: 480-179552-19331.2 Preservation Codes: A - HCL B - NaOH C - Zn Acetate D - Nitric Acid E - NaHSO4 F - MeOH G - Amchlor H - Ascorbic Acid I - Ice J - DI Water K - EDTA L - EDA M - Hexane N - None O - AsNaO2 P - Na2O4S Q - Na2SO3 R - Na2SO4 S - H2SO4 T - TSP Dodecahydrate U - Acetone V - MCAA W - pH 4.5 Y - Trizma Z - other (specify)																																																																																																															
Analysis Requested Due Date Requested: TAT Requested (days): Compliance Project: ☐ Yes ☒ No PO #: Purchase Order not required WO #: 48002774 Project #: 48002774 SOW#:																																																																																																																			
Sample Identification <table border="1"> <thead> <tr> <th>Sample ID</th> <th>Sample Date</th> <th>Sample Time</th> <th>Sample Type (C=Comp, G=Grab)</th> <th>Matrix (W=water, S=solid, O=oil, BT=Tissue, A=air)</th> <th>Field Filtered Sample (Yes or No)</th> <th>8260C - (MOD) Local Method</th> <th>6010C - T. Cd/Cr/Pb (ICP)</th> <th>6010C - D. Cd/Cr/Pb (ICP)</th> <th>Total Number of Containers</th> <th>Special Instructions/Note:</th> </tr> </thead> <tbody> <tr> <td>MW-7</td> <td>12-5-22</td> <td>13:14</td> <td>G</td> <td>Water</td> <td></td> <td>X</td> <td>X</td> <td>X</td> <td>5</td> <td>D. METALS</td> </tr> <tr> <td>MW-9</td> <td>12-2-22</td> <td>13:22</td> <td></td> <td>Water</td> <td></td> <td>X</td> <td>X</td> <td>X</td> <td>5</td> <td>ARE FIELD</td> </tr> <tr> <td>MW-9D</td> <td>12-2-22</td> <td>14:29</td> <td></td> <td>Water</td> <td></td> <td>X</td> <td>X</td> <td>X</td> <td>4</td> <td>FILTERED</td> </tr> <tr> <td>TRIP BLANK</td> <td>12-6-22</td> <td>9:30</td> <td></td> <td>Water</td> <td></td> <td>X</td> <td>X</td> <td>X</td> <td>5</td> <td></td> </tr> <tr> <td>Dup</td> <td>12-5-22</td> <td>12:16</td> <td></td> <td>Water</td> <td></td> <td>X</td> <td>X</td> <td>X</td> <td>5</td> <td></td> </tr> <tr> <td>MS</td> <td>12-5-22</td> <td>10:59</td> <td></td> <td>Water</td> <td></td> <td>X</td> <td>X</td> <td>X</td> <td>5</td> <td></td> </tr> <tr> <td>MSD</td> <td>12-5-22</td> <td>10:59</td> <td></td> <td>Water</td> <td></td> <td>X</td> <td>X</td> <td>X</td> <td>5</td> <td></td> </tr> <tr> <td></td> <td></td> <td></td> <td></td> <td>Water</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td></td> <td></td> <td></td> <td></td> <td>Water</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </tbody> </table>						Sample ID	Sample Date	Sample Time	Sample Type (C=Comp, G=Grab)	Matrix (W=water, S=solid, O=oil, BT=Tissue, A=air)	Field Filtered Sample (Yes or No)	8260C - (MOD) Local Method	6010C - T. Cd/Cr/Pb (ICP)	6010C - D. Cd/Cr/Pb (ICP)	Total Number of Containers	Special Instructions/Note:	MW-7	12-5-22	13:14	G	Water		X	X	X	5	D. METALS	MW-9	12-2-22	13:22		Water		X	X	X	5	ARE FIELD	MW-9D	12-2-22	14:29		Water		X	X	X	4	FILTERED	TRIP BLANK	12-6-22	9:30		Water		X	X	X	5		Dup	12-5-22	12:16		Water		X	X	X	5		MS	12-5-22	10:59		Water		X	X	X	5		MSD	12-5-22	10:59		Water		X	X	X	5						Water											Water						
Sample ID	Sample Date	Sample Time	Sample Type (C=Comp, G=Grab)	Matrix (W=water, S=solid, O=oil, BT=Tissue, A=air)	Field Filtered Sample (Yes or No)	8260C - (MOD) Local Method	6010C - T. Cd/Cr/Pb (ICP)	6010C - D. Cd/Cr/Pb (ICP)	Total Number of Containers	Special Instructions/Note:																																																																																																									
MW-7	12-5-22	13:14	G	Water		X	X	X	5	D. METALS																																																																																																									
MW-9	12-2-22	13:22		Water		X	X	X	5	ARE FIELD																																																																																																									
MW-9D	12-2-22	14:29		Water		X	X	X	4	FILTERED																																																																																																									
TRIP BLANK	12-6-22	9:30		Water		X	X	X	5																																																																																																										
Dup	12-5-22	12:16		Water		X	X	X	5																																																																																																										
MS	12-5-22	10:59		Water		X	X	X	5																																																																																																										
MSD	12-5-22	10:59		Water		X	X	X	5																																																																																																										
				Water																																																																																																															
				Water																																																																																																															
Possible Hazard Identification ☒ Non-Hazard ☐ Flammable ☐ Skin Irritant ☐ Poison B ☐ Unknown ☐ Radiological Deliverable Requested: I, II, III, IV, Other (specify)																																																																																																																			
Empty Kit Relinquished by: Relinquished by: [Signature] Date/Time:																																																																																																																			
Method of Shipment: Received by: [Signature] Date/Time:																																																																																																																			
Company: Received by: [Signature] Date/Time:																																																																																																																			
Company: Received by: [Signature] Date/Time:																																																																																																																			
Company: Received by: [Signature] Date/Time:																																																																																																																			
Cooler Temperature(s), °C and Other Remarks:																																																																																																																			
Custody Seal No.: Δ Yes Δ No																																																																																																																			

Login Sample Receipt Checklist

Client: KPRG and Associates, Inc.

Job Number: 480-204477-1

Login Number: 204477

List Source: Eurofins Buffalo

List Number: 1

Creator: Yeager, Brian A

Question	Answer	Comment
Radioactivity either was not measured or, if measured, is at or below background	True	
The cooler's custody seal, if present, is intact.	True	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	True	
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	True	
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the sample IDs on the containers and the COC.	True	
Samples are received within Holding Time (Excluding tests with immediate HTs)..	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified	True	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
VOA sample vials do not have headspace or bubble is <6mm (1/4") in diameter.	True	
If necessary, staff have been informed of any short hold time or quick TAT needs	True	
Multiphasic samples are not present.	True	
Samples do not require splitting or compositing.	True	
Sampling Company provided.	True	KPRG
Samples received within 48 hours of sampling.	True	
Samples requiring field filtration have been filtered in the field.	True	
Chlorine Residual checked.	N/A	



Well Purging and Sample Collection

Project No.: BEV-21-007 Well No. MW-6DA Site: PRESTOLITE

Purging Method: Pumped ☒ Bailed ☐ Other: _____

Pump Type: _____ Bailer Type: 2"

Weather Conditions: SHOWERS 37°

Volume Calculation: _____

(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)

(Gals./well vol. x 5 = Total Volume to be removed)

Gals./well vol.: 6.6 / 19.9

Time	Depth to Water (D.T.W.)	Depth to Bottom (D.T.B.)	Volume Removed (gal.)	pH	Cond.	Temp.	Color	Odor Y/N	Turbidity
7:47	13.45	55.0	0	8.66	254.9	48.7	CLEAR	N	CLEAR
7:58			5	8.79	263.1	48.7	CLEAR	N	CLEAR
BAILED DRY @			70						
9 GAL			75						
LET RECOVER			20						
9:00				8.25	359.5	48.5	CLEAR	N	CLEAR
Sample Readings									

Comments: WELL IS IN GOOD CONDITION

Inside Diameter	vol./ft.
1"	0.04
1.25"	0.06
2"	0.16
4"	0.65

Field Blank Taken ☐ Time: _____

Well Duplicate ☐ No.: _____

Signature: [Signature]

Date: 12 / 6 / 22

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Well Purging and Sample Collection

Project No.: BEV-21-007 Well No. MW-2A Site: PRESTOLITE

Purging Method: Pumped ☒ Bailed ☐ Other: _____

Pump Type: _____ Bailer Type: 2"

Weather Conditions: CLOUDY 42°

Volume Calculation: _____

(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)

(Gals./well vol. x 5 = Total Volume to be removed)

Gals./well vol.: 0.5 / 1.6

Time	Depth to Water (D.T.W.)	Depth to Bottom (D.T.B.)	Volume Removed (gal.)	pH	Cond.	Temp.	Color	Odor Y/N	Turbidity
13:49	16.39	19.8	0	7.39	453.1	46.2	RUST	N	TRANSPARENT
13:52			1/2	7.56	410.0	46.4	CLEAR	N	CLEAR
13:54			1	7.56	420.1	46.6	CLEAR	N	CLEAR
13:57			1 1/2	7.54	443.8	47.0	CLEAR	N	CLEAR
14:00			2	7.54	461.5	47.2	CLEAR	N	CLEAR
14:02			2 1/2	7.56	474.0	47.2	CLEAR	N	CLEAR
14:04			3	7.54	487.7	47.4	CLEAR	N	CLEAR
14:07			3 1/2	7.54	496.1	47.4	CLEAR	N	CLEAR
14:09			4	7.53	503.3	47.5	CLEAR	N	CLEAR
14:12			4 1/2	7.52	511.9	47.5	CLEAR	N	CLEAR
Sample Readings									

Comments: WELL IS IN GOOD CONDITION

Inside Diameter	vol./ft.
1"	0.04
1.25"	0.06
2"	0.16
4"	0.65


Field Blank Taken ☐ Time: _____

Well Duplicate ☐ No.: _____

Signature: [Signature]

Date: 12/5/22


HNu/PPM	LEL/%	O2/%	H2S/PPM	CO/PPM	



Volume Calculation: _____

Gals./well vol.: 3.7 / 11.2

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)
(Gals./well vol. x 5 = Total Volume to be removed)

Gals./well vol.: 5.3 / 15.9

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Well Purging and Sample Collection

Project No.: BEN-21-007 Well No. MW-9 Site: PRESTOLITE

Purging Method: Pumped ☒ Bailed ☐ Other: _____

Pump Type: _____ Bailer Type: 2"

Weather Conditions: CLOUDY 37°

Volume Calculation: _____

(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)
(Gals./well vol. x 5 = Total Volume to be removed) Gals./well vol.: 1.9 / 5.7

Time	Depth to Water (D.T.W.)	Depth to Bottom (D.T.B.)	Volume Removed (gal.)	pH	Cond.	Temp.	Color	Odor Y/N	Turbidity
13:02	11.21	23.1	0	7.62	726.8	60.6	BROWN	N	OPAQUE
13:07			2	7.61	676.5	61.3	LT TAN	N	TRANSLUCENT
13:13			4	7.62	650.0	61.2	LT TAN	N	TRANSPARENT
13:19			6	7.63	656.7	61.5	LT TAN	N	TRANSPARENT
13:22			7	7.62	659.2	62.2	LT TAN	N	TRANSPARENT
Sample Readings									

Comments: WELL IS IN GOOD CONDITION

Inside Diameter	vol./ft.
1"	0.04
1.25"	0.06
2"	0.16
4"	0.65


Field Blank Taken ☐ Time: _____

Well Duplicate ☐ No.: _____

Signature: [Signature]

Date: 12 / 2 / 22

HNu/PPM	LEL/%	O2/%	H2S/PPM	CO/PPM	



HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Well Purging and Sample Collection

Project No.: BEV-21-007 Well No. GW-1 Site: PRESTOLITE

Purging Method: Pumped ☒ Bailed ☐ Other: _____

Pump Type: _____ Bailer Type: 2"

Weather Conditions: CLOUDY 32°

Volume Calculation: _____

(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)

(Gals./well vol. x 5 = Total Volume to be removed)

Gals./well vol.: 1.0 / 30

Time	Depth to Water (D.T.W.)	Depth to Bottom (D.T.B.)	Volume Removed (gal.)	pH	Cond.	Temp.	Color	Odor Y/N	Turbidity
10:33	11.63	17.95	0	7.63	792.8	49.3	TAN	N	OPAQUE
10:36			1	7.51	739.3	54.0	LT TAN	N	TRANSPARENT
10:39			2	7.65	728.1	54.2	CLEAR	N	CLEAR
10:42			3	7.53	733.7	54.5	CLEAR	N	CLEAR
10:45			4	7.56	730.3	54.6	CLEAR	N	CLEAR
Sample Readings									

Comments: WELL IN GOOD CONDITION

Inside Diameter	vol./ft.
1"	0.04
1.25"	0.06
2"	0.16
4"	0.65


Field Blank Taken ☐ Time: _____

Well Duplicate ☐ No.: _____


Signature: [Signature]

Date: 12 / 3 / 22

HNu/PPM	LEL/%	O2/%	H2S/PPM	CO/PPM	



HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Gals./well vol.: 1.6 / 4.9

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	

ANALYTICAL REPORT

PREPARED FOR

Attn: Mr. Rich Gnat
KPRG and Associates, Inc.
14665 West Lisbon Road,
Suite 1A
Brookfield, Wisconsin 53005

Generated 6/26/2023 8:56:18 AM

JOB DESCRIPTION

Prestolite site

JOB NUMBER

480-209629-1


Eurofins Buffalo

Job Notes

This report may not be reproduced except in full, and with written approval from the laboratory. The results relate only to the samples tested. For questions please contact the Project Manager at the e-mail address or telephone number listed on this page.

The test results in this report relate only to the samples as received by the laboratory and will meet all requirements of the methodology, with any exceptions noted. This report shall not be reproduced except in full, without the express written approval of the laboratory. All questions should be directed to the Eurofins Environment Testing Northeast, LLC Project Manager.

Authorization



Generated
6/26/2023 8:56:18 AM

Authorized for release by
Rebecca Jones, Project Management Assistant I
Rebecca.Jones@et.eurofinsus.com
Designee for
Brian Fischer, Manager of Project Management
Brian.Fischer@et.eurofinsus.com
(716)504-9835

Table of Contents

Cover Page	1
Table of Contents	3
Definitions/Glossary	4
Case Narrative	5
Detection Summary	6
Client Sample Results	7
Surrogate Summary	13
QC Sample Results	14
QC Association Summary	17
Lab Chronicle	19
Certification Summary	21
Method Summary	22
Sample Summary	23
Detection Limit Exceptions Summary	24
Chain of Custody	25
Receipt Checklists	27



Definitions/Glossary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Qualifiers

GC/MS VOA

Qualifier	Qualifier Description
*1	LCS/LCSD RPD exceeds control limits.
J	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.
U	Indicates the analyte was analyzed for but not detected.

Metals

Qualifier	Qualifier Description
U	Indicates the analyte was analyzed for but not detected.

Glossary

Abbreviation	These commonly used abbreviations may or may not be present in this report.
□	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CFL	Contains Free Liquid
CFU	Colony Forming Unit
CNF	Contains No Free Liquid
DER	Duplicate Error Ratio (normalized absolute difference)
Dil Fac	Dilution Factor
DL	Detection Limit (DoD/DOE)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision Level Concentration (Radiochemistry)
EDL	Estimated Detection Limit (Dioxin)
LOD	Limit of Detection (DoD/DOE)
LOQ	Limit of Quantitation (DoD/DOE)
MCL	EPA recommended "Maximum Contaminant Level"
MDA	Minimum Detectable Activity (Radiochemistry)
MDC	Minimum Detectable Concentration (Radiochemistry)
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
MPN	Most Probable Number
MQL	Method Quantitation Limit
NC	Not Calculated
ND	Not Detected at the reporting limit (or MDL or EDL if shown)
NEG	Negative / Absent
POS	Positive / Present
PQL	Practical Quantitation Limit
PRES	Presumptive
QC	Quality Control
RER	Relative Error Ratio (Radiochemistry)
RL	Reporting Limit or Requested Limit (Radiochemistry)
RPD	Relative Percent Difference, a measure of the relative difference between two points
TEF	Toxicity Equivalent Factor (Dioxin)
TEQ	Toxicity Equivalent Quotient (Dioxin)
TNTC	Too Numerous To Count

Case Narrative

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Job ID: 480-209629-1

Laboratory: Eurofins Buffalo

Narrative

Job Narrative 480-209629-1

Comments

No additional comments.

Receipt

The samples were received on 6/7/2023 2:00 PM. Unless otherwise noted below, the samples arrived in good condition, and where required, properly preserved and on ice. The temperature of the cooler at receipt was 16.2° C.

Receipt Exceptions

The following samples were received at the laboratory outside the required temperature criteria: MW-1 (480-209629-1), MW-12 (480-209629-2), MW-6A (480-209629-3), MW-9 (480-209629-4) and TRIP BLANK (480-209629-5). There was no cooling media present in the cooler.

GC/MS VOA

Method 8260C: The RPD of the laboratory control sample (LCS) and laboratory control sample duplicate (LCSD) for analytical batch 480-672442 recovered outside control limits for the following analyte: Chloroethane. The associated samples are impacted: MW-1 (480-209629-1), MW-12 (480-209629-2), MW-6A (480-209629-3), MW-9 (480-209629-4), TRIP BLANK (480-209629-5) and Dup (480-209629-6).

No additional analytical or quality issues were noted, other than those described above or in the Definitions/Glossary page.

Metals

No analytical or quality issues were noted, other than those described in the Definitions/Glossary page.

Detection Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Client Sample ID: MW-1

Lab Sample ID: 480-209629-1

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	8.4	J	10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-12

Lab Sample ID: 480-209629-2

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	7.5	J	10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-6A

Lab Sample ID: 480-209629-3

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	6.9	J	10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: MW-9

Lab Sample ID: 480-209629-4

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	4.9	J	10	0.46	ug/L	1		8260C	Total/NA

Client Sample ID: TRIP BLANK

Lab Sample ID: 480-209629-5

No Detections.									
----------------	--	--	--	--	--	--	--	--	--

Client Sample ID: Dup

Lab Sample ID: 480-209629-6

Analyte	Result	Qualifier	RL	MDL	Unit	Dil Fac	D	Method	Prep Type
Trichloroethene	7.7	J	10	0.46	ug/L	1		8260C	Total/NA

This Detection Summary does not include radiochemical test results.

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Client Sample ID: MW-1

Lab Sample ID: 480-209629-1

Date Collected: 05/26/23 15:45

Matrix: Ground Water

Date Received: 06/07/23 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/09/23 06:17	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/09/23 06:17	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/09/23 06:17	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/09/23 06:17	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/09/23 06:17	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/09/23 06:17	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/09/23 06:17	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			06/09/23 06:17	1
2-Hexanone	10	U	10	1.2	ug/L			06/09/23 06:17	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/09/23 06:17	1
Acetone	10	U	10	3.0	ug/L			06/09/23 06:17	1
Benzene	10	U	10	0.41	ug/L			06/09/23 06:17	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/09/23 06:17	1
Bromoform	10	U	10	0.26	ug/L			06/09/23 06:17	1
Bromomethane	10	U	10	0.69	ug/L			06/09/23 06:17	1
Carbon disulfide	10	U	10	0.19	ug/L			06/09/23 06:17	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/09/23 06:17	1
Chlorobenzene	10	U	10	0.75	ug/L			06/09/23 06:17	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/09/23 06:17	1
Chloroethane	10	*1 U	10	0.32	ug/L			06/09/23 06:17	1
Chloroform	10	U	10	0.34	ug/L			06/09/23 06:17	1
Chloromethane	10	U	10	0.35	ug/L			06/09/23 06:17	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/09/23 06:17	1
Ethylbenzene	10	U	10	0.74	ug/L			06/09/23 06:17	1
Methylene Chloride	10	U	10	0.44	ug/L			06/09/23 06:17	1
Styrene	10	U	10	0.73	ug/L			06/09/23 06:17	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/09/23 06:17	1
Toluene	10	U	10	0.51	ug/L			06/09/23 06:17	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/09/23 06:17	1
Trichloroethene	8.4	J	10	0.46	ug/L			06/09/23 06:17	1
Vinyl chloride	10	U	10	0.90	ug/L			06/09/23 06:17	1
Xylenes, Total	10	U	10	0.66	ug/L			06/09/23 06:17	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/09/23 06:17	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	108		77 - 120		06/09/23 06:17	1
Toluene-d8 (Surr)	97		80 - 120		06/09/23 06:17	1
4-Bromofluorobenzene (Surr)	101		73 - 120		06/09/23 06:17	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/12/23 08:13	06/21/23 22:11	1
Chromium	10.0	U	10.0		ug/L		06/12/23 08:13	06/21/23 22:11	1
Lead	3.0	U	3.0		ug/L		06/12/23 08:13	06/21/23 22:11	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/13/23 08:31	06/22/23 16:12	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/13/23 08:31	06/22/23 16:12	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/13/23 08:31	06/22/23 16:12	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Client Sample ID: MW-12

Lab Sample ID: 480-209629-2

Date Collected: 05/26/23 15:25

Matrix: Water

Date Received: 06/07/23 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/09/23 06:40	1
1,1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/09/23 06:40	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/09/23 06:40	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/09/23 06:40	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/09/23 06:40	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/09/23 06:40	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/09/23 06:40	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			06/09/23 06:40	1
2-Hexanone	10	U	10	1.2	ug/L			06/09/23 06:40	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/09/23 06:40	1
Acetone	10	U	10	3.0	ug/L			06/09/23 06:40	1
Benzene	10	U	10	0.41	ug/L			06/09/23 06:40	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/09/23 06:40	1
Bromoform	10	U	10	0.26	ug/L			06/09/23 06:40	1
Bromomethane	10	U	10	0.69	ug/L			06/09/23 06:40	1
Carbon disulfide	10	U	10	0.19	ug/L			06/09/23 06:40	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/09/23 06:40	1
Chlorobenzene	10	U	10	0.75	ug/L			06/09/23 06:40	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/09/23 06:40	1
Chloroethane	10	*1 U	10	0.32	ug/L			06/09/23 06:40	1
Chloroform	10	U	10	0.34	ug/L			06/09/23 06:40	1
Chloromethane	10	U	10	0.35	ug/L			06/09/23 06:40	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/09/23 06:40	1
Ethylbenzene	10	U	10	0.74	ug/L			06/09/23 06:40	1
Methylene Chloride	10	U	10	0.44	ug/L			06/09/23 06:40	1
Styrene	10	U	10	0.73	ug/L			06/09/23 06:40	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/09/23 06:40	1
Toluene	10	U	10	0.51	ug/L			06/09/23 06:40	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/09/23 06:40	1
Trichloroethene	7.5	J	10	0.46	ug/L			06/09/23 06:40	1
Vinyl chloride	10	U	10	0.90	ug/L			06/09/23 06:40	1
Xylenes, Total	10	U	10	0.66	ug/L			06/09/23 06:40	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/09/23 06:40	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	103		77 - 120		06/09/23 06:40	1
Toluene-d8 (Surr)	102		80 - 120		06/09/23 06:40	1
4-Bromofluorobenzene (Surr)	103		73 - 120		06/09/23 06:40	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/12/23 08:13	06/21/23 22:15	1
Chromium	10.0	U	10.0		ug/L		06/12/23 08:13	06/21/23 22:15	1
Lead	3.0	U	3.0		ug/L		06/12/23 08:13	06/21/23 22:15	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/13/23 08:31	06/22/23 16:31	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/13/23 08:31	06/22/23 16:31	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/13/23 08:31	06/22/23 16:31	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Client Sample ID: MW-6A

Lab Sample ID: 480-209629-3

Date Collected: 05/26/23 13:45

Matrix: Water

Date Received: 06/07/23 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/09/23 07:03	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/09/23 07:03	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/09/23 07:03	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/09/23 07:03	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/09/23 07:03	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/09/23 07:03	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/09/23 07:03	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			06/09/23 07:03	1
2-Hexanone	10	U	10	1.2	ug/L			06/09/23 07:03	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/09/23 07:03	1
Acetone	10	U	10	3.0	ug/L			06/09/23 07:03	1
Benzene	10	U	10	0.41	ug/L			06/09/23 07:03	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/09/23 07:03	1
Bromoform	10	U	10	0.26	ug/L			06/09/23 07:03	1
Bromomethane	10	U	10	0.69	ug/L			06/09/23 07:03	1
Carbon disulfide	10	U	10	0.19	ug/L			06/09/23 07:03	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/09/23 07:03	1
Chlorobenzene	10	U	10	0.75	ug/L			06/09/23 07:03	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/09/23 07:03	1
Chloroethane	10	*1 U	10	0.32	ug/L			06/09/23 07:03	1
Chloroform	10	U	10	0.34	ug/L			06/09/23 07:03	1
Chloromethane	10	U	10	0.35	ug/L			06/09/23 07:03	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/09/23 07:03	1
Ethylbenzene	10	U	10	0.74	ug/L			06/09/23 07:03	1
Methylene Chloride	10	U	10	0.44	ug/L			06/09/23 07:03	1
Styrene	10	U	10	0.73	ug/L			06/09/23 07:03	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/09/23 07:03	1
Toluene	10	U	10	0.51	ug/L			06/09/23 07:03	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/09/23 07:03	1
Trichloroethene	6.9	J	10	0.46	ug/L			06/09/23 07:03	1
Vinyl chloride	10	U	10	0.90	ug/L			06/09/23 07:03	1
Xylenes, Total	10	U	10	0.66	ug/L			06/09/23 07:03	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/09/23 07:03	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	107		77 - 120		06/09/23 07:03	1
Toluene-d8 (Surr)	103		80 - 120		06/09/23 07:03	1
4-Bromofluorobenzene (Surr)	104		73 - 120		06/09/23 07:03	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/12/23 08:13	06/21/23 22:19	1
Chromium	10.0	U	10.0		ug/L		06/12/23 08:13	06/21/23 22:19	1
Lead	3.0	U	3.0		ug/L		06/12/23 08:13	06/21/23 22:19	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/13/23 08:31	06/22/23 16:35	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/13/23 08:31	06/22/23 16:35	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/13/23 08:31	06/22/23 16:35	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Client Sample ID: MW-9

Lab Sample ID: 480-209629-4

Date Collected: 05/26/23 14:35

Matrix: Water

Date Received: 06/07/23 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/09/23 07:27	1
1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/09/23 07:27	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/09/23 07:27	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/09/23 07:27	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/09/23 07:27	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/09/23 07:27	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/09/23 07:27	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			06/09/23 07:27	1
2-Hexanone	10	U	10	1.2	ug/L			06/09/23 07:27	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/09/23 07:27	1
Acetone	10	U	10	3.0	ug/L			06/09/23 07:27	1
Benzene	10	U	10	0.41	ug/L			06/09/23 07:27	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/09/23 07:27	1
Bromoform	10	U	10	0.26	ug/L			06/09/23 07:27	1
Bromomethane	10	U	10	0.69	ug/L			06/09/23 07:27	1
Carbon disulfide	10	U	10	0.19	ug/L			06/09/23 07:27	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/09/23 07:27	1
Chlorobenzene	10	U	10	0.75	ug/L			06/09/23 07:27	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/09/23 07:27	1
Chloroethane	10	*1 U	10	0.32	ug/L			06/09/23 07:27	1
Chloroform	10	U	10	0.34	ug/L			06/09/23 07:27	1
Chloromethane	10	U	10	0.35	ug/L			06/09/23 07:27	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/09/23 07:27	1
Ethylbenzene	10	U	10	0.74	ug/L			06/09/23 07:27	1
Methylene Chloride	10	U	10	0.44	ug/L			06/09/23 07:27	1
Styrene	10	U	10	0.73	ug/L			06/09/23 07:27	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/09/23 07:27	1
Toluene	10	U	10	0.51	ug/L			06/09/23 07:27	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/09/23 07:27	1
Trichloroethene	4.9	J	10	0.46	ug/L			06/09/23 07:27	1
Vinyl chloride	10	U	10	0.90	ug/L			06/09/23 07:27	1
Xylenes, Total	10	U	10	0.66	ug/L			06/09/23 07:27	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/09/23 07:27	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	104		77 - 120		06/09/23 07:27	1
Toluene-d8 (Surr)	101		80 - 120		06/09/23 07:27	1
4-Bromofluorobenzene (Surr)	103		73 - 120		06/09/23 07:27	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/12/23 08:13	06/21/23 22:23	1
Chromium	10.0	U	10.0		ug/L		06/12/23 08:13	06/21/23 22:23	1
Lead	3.0	U	3.0		ug/L		06/12/23 08:13	06/21/23 22:23	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/13/23 08:31	06/22/23 16:50	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/13/23 08:31	06/22/23 16:50	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/13/23 08:31	06/22/23 16:50	1

Eurofins Buffalo

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Client Sample ID: TRIP BLANK

Lab Sample ID: 480-209629-5

Date Collected: 05/26/23 00:00

Matrix: Water

Date Received: 06/07/23 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/09/23 07:50	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/09/23 07:50	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/09/23 07:50	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/09/23 07:50	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/09/23 07:50	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/09/23 07:50	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/09/23 07:50	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			06/09/23 07:50	1
2-Hexanone	10	U	10	1.2	ug/L			06/09/23 07:50	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/09/23 07:50	1
Acetone	10	U	10	3.0	ug/L			06/09/23 07:50	1
Benzene	10	U	10	0.41	ug/L			06/09/23 07:50	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/09/23 07:50	1
Bromoform	10	U	10	0.26	ug/L			06/09/23 07:50	1
Bromomethane	10	U	10	0.69	ug/L			06/09/23 07:50	1
Carbon disulfide	10	U	10	0.19	ug/L			06/09/23 07:50	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/09/23 07:50	1
Chlorobenzene	10	U	10	0.75	ug/L			06/09/23 07:50	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/09/23 07:50	1
Chloroethane	10	*1 U	10	0.32	ug/L			06/09/23 07:50	1
Chloroform	10	U	10	0.34	ug/L			06/09/23 07:50	1
Chloromethane	10	U	10	0.35	ug/L			06/09/23 07:50	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/09/23 07:50	1
Ethylbenzene	10	U	10	0.74	ug/L			06/09/23 07:50	1
Methylene Chloride	10	U	10	0.44	ug/L			06/09/23 07:50	1
Styrene	10	U	10	0.73	ug/L			06/09/23 07:50	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/09/23 07:50	1
Toluene	10	U	10	0.51	ug/L			06/09/23 07:50	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/09/23 07:50	1
Trichloroethene	10	U	10	0.46	ug/L			06/09/23 07:50	1
Vinyl chloride	10	U	10	0.90	ug/L			06/09/23 07:50	1
Xylenes, Total	10	U	10	0.66	ug/L			06/09/23 07:50	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/09/23 07:50	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	105		77 - 120		06/09/23 07:50	1
Toluene-d8 (Surr)	102		80 - 120		06/09/23 07:50	1
4-Bromofluorobenzene (Surr)	105		73 - 120		06/09/23 07:50	1

Client Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Client Sample ID: Dup

Lab Sample ID: 480-209629-6

Date Collected: 05/26/23 00:00

Matrix: Water

Date Received: 06/07/23 14:00

Method: SW846 8260C - Volatile Organic Compounds by GC/MS

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/09/23 08:13	1
1,1,1,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/09/23 08:13	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/09/23 08:13	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/09/23 08:13	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/09/23 08:13	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/09/23 08:13	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/09/23 08:13	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			06/09/23 08:13	1
2-Hexanone	10	U	10	1.2	ug/L			06/09/23 08:13	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/09/23 08:13	1
Acetone	10	U	10	3.0	ug/L			06/09/23 08:13	1
Benzene	10	U	10	0.41	ug/L			06/09/23 08:13	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/09/23 08:13	1
Bromoform	10	U	10	0.26	ug/L			06/09/23 08:13	1
Bromomethane	10	U	10	0.69	ug/L			06/09/23 08:13	1
Carbon disulfide	10	U	10	0.19	ug/L			06/09/23 08:13	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/09/23 08:13	1
Chlorobenzene	10	U	10	0.75	ug/L			06/09/23 08:13	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/09/23 08:13	1
Chloroethane	10	*1 U	10	0.32	ug/L			06/09/23 08:13	1
Chloroform	10	U	10	0.34	ug/L			06/09/23 08:13	1
Chloromethane	10	U	10	0.35	ug/L			06/09/23 08:13	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/09/23 08:13	1
Ethylbenzene	10	U	10	0.74	ug/L			06/09/23 08:13	1
Methylene Chloride	10	U	10	0.44	ug/L			06/09/23 08:13	1
Styrene	10	U	10	0.73	ug/L			06/09/23 08:13	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/09/23 08:13	1
Toluene	10	U	10	0.51	ug/L			06/09/23 08:13	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/09/23 08:13	1
Trichloroethene	7.7	J	10	0.46	ug/L			06/09/23 08:13	1
Vinyl chloride	10	U	10	0.90	ug/L			06/09/23 08:13	1
Xylenes, Total	10	U	10	0.66	ug/L			06/09/23 08:13	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/09/23 08:13	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	106		77 - 120		06/09/23 08:13	1
Toluene-d8 (Surr)	99		80 - 120		06/09/23 08:13	1
4-Bromofluorobenzene (Surr)	99		73 - 120		06/09/23 08:13	1

Method: SW846 6010C - Metals (ICP)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/12/23 08:13	06/21/23 22:27	1
Chromium	10.0	U	10.0		ug/L		06/12/23 08:13	06/21/23 22:27	1
Lead	3.0	U	3.0		ug/L		06/12/23 08:13	06/21/23 22:27	1

Method: SW846 6010C - Metals (ICP) - Dissolved

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/13/23 08:31	06/22/23 16:54	1
Chromium, Dissolved	10.0	U	10.0		ug/L		06/13/23 08:31	06/22/23 16:54	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/13/23 08:31	06/22/23 16:54	1

Eurofins Buffalo

Surrogate Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Method: 8260C - Volatile Organic Compounds by GC/MS

Matrix: Ground Water

Prep Type: Total/NA

Lab Sample ID	Client Sample ID	Percent Surrogate Recovery (Acceptance Limits)		
		DCA (77-120)	TOL (80-120)	BFB (73-120)
480-209629-1	MW-1	108	97	101
Surrogate Legend				
DCA = 1,2-Dichloroethane-d4 (Surr)				
TOL = Toluene-d8 (Surr)				
BFB = 4-Bromofluorobenzene (Surr)				

Method: 8260C - Volatile Organic Compounds by GC/MS

Matrix: Water

Prep Type: Total/NA

Lab Sample ID	Client Sample ID	Percent Surrogate Recovery (Acceptance Limits)		
		DCA (77-120)	TOL (80-120)	BFB (73-120)
480-209629-2	MW-12	103	102	103
480-209629-3	MW-6A	107	103	104
480-209629-4	MW-9	104	101	103
480-209629-5	TRIP BLANK	105	102	105
480-209629-6	Dup	106	99	99
LCS 480-672442/6	Lab Control Sample	103	102	104
LCSD 480-672442/26	Lab Control Sample Dup	102	103	97
MB 480-672442/8	Method Blank	107	100	106
Surrogate Legend				
DCA = 1,2-Dichloroethane-d4 (Surr)				
TOL = Toluene-d8 (Surr)				
BFB = 4-Bromofluorobenzene (Surr)				

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Method: 8260C - Volatile Organic Compounds by GC/MS

Lab Sample ID: MB 480-672442/8

Matrix: Water

Analysis Batch: 672442

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1-Trichloroethane	10	U	10	0.82	ug/L			06/09/23 05:54	1
1,1,1,2,2-Tetrachloroethane	10	U	10	0.21	ug/L			06/09/23 05:54	1
1,1,2-Trichloroethane	10	U	10	0.23	ug/L			06/09/23 05:54	1
1,1-Dichloroethane	10	U	10	0.38	ug/L			06/09/23 05:54	1
1,1-Dichloroethene	10	U	10	0.29	ug/L			06/09/23 05:54	1
1,2-Dichloroethane	10	U	10	0.21	ug/L			06/09/23 05:54	1
1,2-Dichloropropane	10	U	10	0.72	ug/L			06/09/23 05:54	1
2-Butanone (MEK)	10	U	10	1.3	ug/L			06/09/23 05:54	1
2-Hexanone	10	U	10	1.2	ug/L			06/09/23 05:54	1
4-Methyl-2-pentanone (MIBK)	10	U	10	2.1	ug/L			06/09/23 05:54	1
Acetone	10	U	10	3.0	ug/L			06/09/23 05:54	1
Benzene	10	U	10	0.41	ug/L			06/09/23 05:54	1
Bromodichloromethane	10	U	10	0.39	ug/L			06/09/23 05:54	1
Bromoform	10	U	10	0.26	ug/L			06/09/23 05:54	1
Bromomethane	10	U	10	0.69	ug/L			06/09/23 05:54	1
Carbon disulfide	10	U	10	0.19	ug/L			06/09/23 05:54	1
Carbon tetrachloride	10	U	10	0.27	ug/L			06/09/23 05:54	1
Chlorobenzene	10	U	10	0.75	ug/L			06/09/23 05:54	1
Dibromochloromethane	10	U	10	0.32	ug/L			06/09/23 05:54	1
Chloroethane	10	U	10	0.32	ug/L			06/09/23 05:54	1
Chloroform	10	U	10	0.34	ug/L			06/09/23 05:54	1
Chloromethane	10	U	10	0.35	ug/L			06/09/23 05:54	1
cis-1,3-Dichloropropene	10	U	10	0.36	ug/L			06/09/23 05:54	1
Ethylbenzene	10	U	10	0.74	ug/L			06/09/23 05:54	1
Methylene Chloride	10	U	10	0.44	ug/L			06/09/23 05:54	1
Styrene	10	U	10	0.73	ug/L			06/09/23 05:54	1
Tetrachloroethene	10	U	10	0.36	ug/L			06/09/23 05:54	1
Toluene	10	U	10	0.51	ug/L			06/09/23 05:54	1
trans-1,3-Dichloropropene	10	U	10	0.37	ug/L			06/09/23 05:54	1
Trichloroethene	10	U	10	0.46	ug/L			06/09/23 05:54	1
Vinyl chloride	10	U	10	0.90	ug/L			06/09/23 05:54	1
Xylenes, Total	10	U	10	0.66	ug/L			06/09/23 05:54	1
1,2-Dichloroethene, Total	10	U	10	0.81	ug/L			06/09/23 05:54	1

Surrogate	MB %Recovery	MB Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	107		77 - 120		06/09/23 05:54	1
Toluene-d8 (Surr)	100		80 - 120		06/09/23 05:54	1
4-Bromofluorobenzene (Surr)	106		73 - 120		06/09/23 05:54	1

Lab Sample ID: LCS 480-672442/6

Matrix: Water

Analysis Batch: 672442

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
1,1-Dichloroethane	25.0	24.6		ug/L		98	77 - 120
Benzene	25.0	24.7		ug/L		99	71 - 124
Chlorobenzene	25.0	26.1		ug/L		104	80 - 120
Toluene	25.0	25.3		ug/L		101	80 - 122

Eurofins Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Method: 8260C - Volatile Organic Compounds by GC/MS (Continued)

Lab Sample ID: LCS 480-672442/6

Matrix: Water

Analysis Batch: 672442

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Trichloroethene	25.0	25.3		ug/L		101	74 - 123
Surrogate	LCS %Recovery	LCS Qualifier	Limits				
1,2-Dichloroethane-d4 (Surr)	103		77 - 120				
Toluene-d8 (Surr)	102		80 - 120				
4-Bromofluorobenzene (Surr)	104		73 - 120				

Lab Sample ID: LCSD 480-672442/26

Matrix: Water

Analysis Batch: 672442

Client Sample ID: Lab Control Sample Dup

Prep Type: Total/NA

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
1,1-Dichloroethane	25.0	26.8		ug/L		107	77 - 120	9	20
Benzene	25.0	24.7		ug/L		99	71 - 124	0	13
Chlorobenzene	25.0	26.3		ug/L		105	80 - 120	1	25
Toluene	25.0	26.6		ug/L		107	80 - 122	5	15
Trichloroethene	25.0	25.6		ug/L		102	74 - 123	1	16
Surrogate	LCSD %Recovery	LCSD Qualifier	Limits						
1,2-Dichloroethane-d4 (Surr)	102		77 - 120						
Toluene-d8 (Surr)	103		80 - 120						
4-Bromofluorobenzene (Surr)	97		73 - 120						

Method: 6010C - Metals (ICP)

Lab Sample ID: MB 480-672569/1-A

Matrix: Water

Analysis Batch: 674038

Client Sample ID: Method Blank

Prep Type: Total/NA

Prep Batch: 672569

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium	5.0	U	5.0		ug/L		06/12/23 08:13	06/21/23 20:59	1
Chromium	10.0	U	10.0		ug/L		06/12/23 08:13	06/21/23 20:59	1
Lead	3.0	U	3.0		ug/L		06/12/23 08:13	06/21/23 20:59	1

Lab Sample ID: LCS 480-672569/2-A

Matrix: Water

Analysis Batch: 674038

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Prep Batch: 672569

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Cadmium	200	228.1		ug/L		114	80 - 120
Chromium	201	226.9		ug/L		113	80 - 120
Lead	200	238.2		ug/L		119	80 - 120

Lab Sample ID: MB 480-672752/1-A

Matrix: Water

Analysis Batch: 674247

Client Sample ID: Method Blank

Prep Type: Total Recoverable

Prep Batch: 672752

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Cadmium, Dissolved	5.0	U	5.0		ug/L		06/13/23 08:31	06/22/23 15:38	1

Eurofins Buffalo

QC Sample Results

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Method: 6010C - Metals (ICP) (Continued)

Lab Sample ID: MB 480-672752/1-A

Matrix: Water

Analysis Batch: 674247

Client Sample ID: Method Blank

Prep Type: Total Recoverable

Prep Batch: 672752

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chromium, Dissolved	10.0	U	10.0		ug/L		06/13/23 08:31	06/22/23 15:38	1
Lead, Dissolved	3.0	U	3.0		ug/L		06/13/23 08:31	06/22/23 15:38	1

Lab Sample ID: LCS 480-672752/2-A

Matrix: Water

Analysis Batch: 674247

Client Sample ID: Lab Control Sample

Prep Type: Total Recoverable

Prep Batch: 672752

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Cadmium, Dissolved	200	236.2		ug/L		118	80 - 120
Chromium, Dissolved	201	234.6		ug/L		117	80 - 120
Lead, Dissolved	200	228.0		ug/L		114	80 - 120

Lab Sample ID: 480-209629-1 MS

Matrix: Ground Water

Analysis Batch: 674247

Client Sample ID: MW-1

Prep Type: Dissolved

Prep Batch: 672752

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Cadmium, Dissolved	5.0		200	233.2		ug/L		117	75 - 125
Chromium, Dissolved	10.0		201	226.9		ug/L		113	75 - 125
Lead, Dissolved	3.0		200	226.8		ug/L		113	75 - 125

Lab Sample ID: 480-209629-1 MSD

Matrix: Ground Water

Analysis Batch: 674247

Client Sample ID: MW-1

Prep Type: Dissolved

Prep Batch: 672752

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Cadmium, Dissolved	5.0		200	230.4		ug/L		115	75 - 125	1	20
Chromium, Dissolved	10.0		201	225.2		ug/L		112	75 - 125	1	20
Lead, Dissolved	3.0		200	224.9		ug/L		112	75 - 125	1	20

QC Association Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

GC/MS VOA

Analysis Batch: 672442

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-209629-1	MW-1	Total/NA	Ground Water	8260C	
480-209629-2	MW-12	Total/NA	Water	8260C	
480-209629-3	MW-6A	Total/NA	Water	8260C	
480-209629-4	MW-9	Total/NA	Water	8260C	
480-209629-5	TRIP BLANK	Total/NA	Water	8260C	
480-209629-6	Dup	Total/NA	Water	8260C	
MB 480-672442/8	Method Blank	Total/NA	Water	8260C	
LCS 480-672442/6	Lab Control Sample	Total/NA	Water	8260C	
LCSD 480-672442/26	Lab Control Sample Dup	Total/NA	Water	8260C	

Metals

Prep Batch: 672569

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-209629-1	MW-1	Total/NA	Ground Water	3005A	
480-209629-2	MW-12	Total/NA	Water	3005A	
480-209629-3	MW-6A	Total/NA	Water	3005A	
480-209629-4	MW-9	Total/NA	Water	3005A	
480-209629-6	Dup	Total/NA	Water	3005A	
MB 480-672569/1-A	Method Blank	Total/NA	Water	3005A	
LCS 480-672569/2-A	Lab Control Sample	Total/NA	Water	3005A	

Prep Batch: 672752

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-209629-1	MW-1	Dissolved	Ground Water	3005A	
480-209629-2	MW-12	Dissolved	Water	3005A	
480-209629-3	MW-6A	Dissolved	Water	3005A	
480-209629-4	MW-9	Dissolved	Water	3005A	
480-209629-6	Dup	Dissolved	Water	3005A	
MB 480-672752/1-A	Method Blank	Total Recoverable	Water	3005A	
LCS 480-672752/2-A	Lab Control Sample	Total Recoverable	Water	3005A	
480-209629-1 MS	MW-1	Dissolved	Ground Water	3005A	
480-209629-1 MSD	MW-1	Dissolved	Ground Water	3005A	

Analysis Batch: 674038

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-209629-1	MW-1	Total/NA	Ground Water	6010C	672569
480-209629-2	MW-12	Total/NA	Water	6010C	672569
480-209629-3	MW-6A	Total/NA	Water	6010C	672569
480-209629-4	MW-9	Total/NA	Water	6010C	672569
480-209629-6	Dup	Total/NA	Water	6010C	672569
MB 480-672569/1-A	Method Blank	Total/NA	Water	6010C	672569
LCS 480-672569/2-A	Lab Control Sample	Total/NA	Water	6010C	672569

Analysis Batch: 674247

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
480-209629-1	MW-1	Dissolved	Ground Water	6010C	672752
480-209629-2	MW-12	Dissolved	Water	6010C	672752
480-209629-3	MW-6A	Dissolved	Water	6010C	672752
480-209629-4	MW-9	Dissolved	Water	6010C	672752
480-209629-6	Dup	Dissolved	Water	6010C	672752

Eurofins Buffalo

QC Association Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Metals (Continued)

Analysis Batch: 674247 (Continued)

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
MB 480-672752/1-A	Method Blank	Total Recoverable	Water	6010C	672752
LCS 480-672752/2-A	Lab Control Sample	Total Recoverable	Water	6010C	672752
480-209629-1 MS	MW-1	Dissolved	Ground Water	6010C	672752
480-209629-1 MSD	MW-1	Dissolved	Ground Water	6010C	672752

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Client Sample ID: MW-1

Lab Sample ID: 480-209629-1

Date Collected: 05/26/23 15:45

Matrix: Ground Water

Date Received: 06/07/23 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	672442	ATG	EET BUF	06/09/23 06:17
Dissolved	Prep	3005A			672752	VAK	EET BUF	06/13/23 08:31
Dissolved	Analysis	6010C		1	674247	LMH	EET BUF	06/22/23 16:12
Total/NA	Prep	3005A			672569	MP	EET BUF	06/12/23 08:13
Total/NA	Analysis	6010C		1	674038	LMH	EET BUF	06/21/23 22:11

Client Sample ID: MW-12

Lab Sample ID: 480-209629-2

Date Collected: 05/26/23 15:25

Matrix: Water

Date Received: 06/07/23 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	672442	ATG	EET BUF	06/09/23 06:40
Dissolved	Prep	3005A			672752	VAK	EET BUF	06/13/23 08:31
Dissolved	Analysis	6010C		1	674247	LMH	EET BUF	06/22/23 16:31
Total/NA	Prep	3005A			672569	MP	EET BUF	06/12/23 08:13
Total/NA	Analysis	6010C		1	674038	LMH	EET BUF	06/21/23 22:15

Client Sample ID: MW-6A

Lab Sample ID: 480-209629-3

Date Collected: 05/26/23 13:45

Matrix: Water

Date Received: 06/07/23 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	672442	ATG	EET BUF	06/09/23 07:03
Dissolved	Prep	3005A			672752	VAK	EET BUF	06/13/23 08:31
Dissolved	Analysis	6010C		1	674247	LMH	EET BUF	06/22/23 16:35
Total/NA	Prep	3005A			672569	MP	EET BUF	06/12/23 08:13
Total/NA	Analysis	6010C		1	674038	LMH	EET BUF	06/21/23 22:19

Client Sample ID: MW-9

Lab Sample ID: 480-209629-4

Date Collected: 05/26/23 14:35

Matrix: Water

Date Received: 06/07/23 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	672442	ATG	EET BUF	06/09/23 07:27
Dissolved	Prep	3005A			672752	VAK	EET BUF	06/13/23 08:31
Dissolved	Analysis	6010C		1	674247	LMH	EET BUF	06/22/23 16:50
Total/NA	Prep	3005A			672569	MP	EET BUF	06/12/23 08:13
Total/NA	Analysis	6010C		1	674038	LMH	EET BUF	06/21/23 22:23

Client Sample ID: TRIP BLANK

Lab Sample ID: 480-209629-5

Date Collected: 05/26/23 00:00

Matrix: Water

Date Received: 06/07/23 14:00

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	672442	ATG	EET BUF	06/09/23 07:50

Eurofins Buffalo

Lab Chronicle

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Client Sample ID: Dup
Date Collected: 05/26/23 00:00
Date Received: 06/07/23 14:00

Lab Sample ID: 480-209629-6
Matrix: Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260C		1	672442	ATG	EET BUF	06/09/23 08:13
Dissolved	Prep	3005A			672752	VAK	EET BUF	06/13/23 08:31
Dissolved	Analysis	6010C		1	674247	LMH	EET BUF	06/22/23 16:54
Total/NA	Prep	3005A			672569	MP	EET BUF	06/12/23 08:13
Total/NA	Analysis	6010C		1	674038	LMH	EET BUF	06/21/23 22:27

Laboratory References:
EET BUF = Eurofins Buffalo, 10 Hazelwood Drive, Amherst, NY 14228-2298, TEL (716)691-2600

Accreditation/Certification Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Laboratory: Eurofins Buffalo

Unless otherwise noted, all analytes for this laboratory were covered under each accreditation/certification below.

Authority	Program	Identification Number	Expiration Date
New York	NELAP	10026	03-31-24

The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.

Analysis Method	Prep Method	Matrix	Analyte
8260C		Ground Water	1,2-Dichloroethene, Total
8260C		Water	1,2-Dichloroethene, Total

Method Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Method	Method Description	Protocol	Laboratory
8260C	Volatile Organic Compounds by GC/MS	SW846	EET BUF
6010C	Metals (ICP)	SW846	EET BUF
3005A	Preparation, Total Metals	SW846	EET BUF
3005A	Preparation, Total Recoverable or Dissolved Metals	SW846	EET BUF
5030C	Purge and Trap	SW846	EET BUF

Protocol References:

SW846 = "Test Methods For Evaluating Solid Waste, Physical/Chemical Methods", Third Edition, November 1986 And Its Updates.

Laboratory References:

EET BUF = Eurofins Buffalo, 10 Hazelwood Drive, Amherst, NY 14228-2298, TEL (716)691-2600

Sample Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

Lab Sample ID	Client Sample ID	Matrix	Collected	Received
480-209629-1	MW-1	Ground Water	05/26/23 15:45	06/07/23 14:00
480-209629-2	MW-12	Water	05/26/23 15:25	06/07/23 14:00
480-209629-3	MW-6A	Water	05/26/23 13:45	06/07/23 14:00
480-209629-4	MW-9	Water	05/26/23 14:35	06/07/23 14:00
480-209629-5	TRIP BLANK	Water	05/26/23 00:00	06/07/23 14:00
480-209629-6	Dup	Water	05/26/23 00:00	06/07/23 14:00

Quantitation Limit Exceptions Summary

Client: KPRG and Associates, Inc.
Project/Site: Prestolite site

Job ID: 480-209629-1

The requested project specific reporting limits listed below were less than laboratory standard quantitation limits (PQL) but greater than or equal to the laboratory method detection limits (MDL). It must be noted that results reported below lab standard quantitation limits may result in false positive/false negative values and less accurate quantitation. Routine laboratory procedures do not indicate corrective action for detections below the laboratory's PQL.

Method	Analyte	Matrix	Prep Type	Unit	Client RL	Lab PQL
6010C	Lead	Ground Water	Total/NA	ug/L	3.0	10
6010C	Lead	Water	Total/NA	ug/L	3.0	10
6010C	Lead, Dissolved	Ground Water	Dissolved	ug/L	3.0	10
6010C	Lead, Dissolved	Water	Dissolved	ug/L	3.0	10

Chain of Custody Record



Client Information Client Contact: Patrick Allenstein Company: KPRG and Associates, Inc. Address: 14665 West Lisbon Road, Suite 1A City: Brookfield State: WI, Zip: 53005 Phone: 262-781-0475(Tel) Email: patricka@kprginc.com Project Name: Prestolite site/ Event Desc: Prestolite site Site: New York		Lab PM: Fischer, Brian J Carrier Tracking No(s): 480-184812-19331.1 State of Origin: NY E-Mail: Brian.Fischer@et.eurofinsus.com PWSID	
Due Date Requested: TAT Requested (days): per contract Compliance Project: ☐ Yes ☒ No PO #: 262-781-0475(Tel) Purchase Order not required WO #: Project #: 48002774 SSOW#		Analysis Requested Preservation Codes: A - HCL B - NaOH C - Zn Acetate D - Nitric Acid E - NaHSO4 F - MeOH G - Amchlor H - Ascorbic Acid I - Ice J - DI Water K - EDTA L - EDA M - Hexane N - None O - AsNaO2 P - Na2O4S Q - Na2SO3 R - Na2S2O3 S - H2SO4 T - TSP Dodecahydrate U - Acetone V - MCAA W - pH 4.5 Y - Trizma Z - other (specify) Other:	
Sample Identification		480-209629 Chain of Custody	
Sample ID MW-1 MW-11 MW-12 MW-13 MW-14 MW-1DA MW-2A MW-3 MW-5 MW-6A MW-6DA	Sample Date 5/26/2023 5/26/2023 5/26/2023 5/26/2023 5/26/2023 5/26/2023 5/26/2023 5/26/2023 5/26/2023 5/26/2023	Sample Time 1545 1525 1525 1525 1525 1525 1525 1525 1525 1525	Matrix (W=water, S=solid, O=organic) Water Water Water Water Water Water Water Water Water Water
Sample Type (C=Comp, G=grab) G G G G G G G G G G		Preservation Code: A D D D D D D D D D D	
Field Filtered Sample (Yes or No) X X X X X X X X X X X		Perform MS/MSD (Yes or No) X X X X X X X X X X X	
8260C - (MOD) Local Method 6010C - T. Cd/Cr/Pb (ICP) 6010C - D. Cd/Cr/Pb (ICP)		37 containers	
Possible Hazard Identification ☒ Non-Hazard ☐ Flammable ☐ Skin Irritant ☐ Poison B ☐ Unknown ☐ Radiological Deliverable Requested I, II, III, IV, Other (specify)			
Sample Disposal (A fee may be assessed if samples are retained longer than 1 month) ☐ Return To Client ☐ Disposal By Lab ☐ Archive For _____ Months			
Special Instructions/QC Requirements			
Empty Kit Relinquished by Relinquished by: Grav Hagberg Relinquished by: Grav Hagberg Relinquished by:		Date: 5/26/2023 @ 1715 Date/Time: 5/26/2023 @ 1715 Date/Time:	
Custody Seals Intact ☒ Yes ☐ No		Cooler Temperature(s) °C and Other Remarks: 16.2 #1 160 ICE	

[illegible]

Login Sample Receipt Checklist

Client: KPRG and Associates, Inc.

Job Number: 480-209629-1


Login Number: 209629

List Source: Eurofins Buffalo

List Number: 1

Creator: Kolb, Chris M


Question	Answer	Comment
Radioactivity either was not measured or, if measured, is at or below background	True	
The cooler's custody seal, if present, is intact.	True	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	False	
Cooler Temperature is acceptable.	False	
Cooler Temperature is recorded.	True	
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the sample IDs on the containers and the COC.	True	
Samples are received within Holding Time (Excluding tests with immediate HTs)..	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified	True	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
VOA sample vials do not have headspace or bubble is <6mm (1/4") in diameter.	True	
If necessary, staff have been informed of any short hold time or quick TAT needs	True	
Multiphasic samples are not present.	True	
Samples do not require splitting or compositing.	True	
Sampling Company provided.	True	ATL
Samples received within 48 hours of sampling.	False	
Samples requiring field filtration have been filtered in the field.	True	
Chlorine Residual checked.	N/A	



(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)
(Gals./well vol. x 5 = Total Volume to be removed)

Gals./well vol.: _____

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	




(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)
(Gals./well vol. x 5 = Total Volume to be removed) Gals./well vol.: _____

Comments: well in good condition.
measurement line added. No sample
needed per contract.


Date: 5/20/2023

HNu/PPM	LEL/%	CU/%	H ₂ S/PPM	CO/PPM	




Gals./well vol.:

HNw/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	




HNU/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



Gals./well vol.: _____

HNw/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	




(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)
(Gals./well vol. x 5 = Total Volume to be removed)

Gals./well vol.: _____


Date: 5, 20/1 2023

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	




(D.T.B. - D.T.W. x vol./ft. = Gals./well vol.)
(Gals./well vol. x 5 = Total Volume to be removed)

HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	



HNu/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	




Volume Calculation: _____

Gals./well vol.: _____

Comments: Well in good condition. measurement
 MANC added. no sample per contract.

Date: 5/26/2023

HNw/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	




HNw/PPM	LEL/%	O ₂ /%	H ₂ S/PPM	CO/PPM	

ATTACHMENT 4


VOC Time vs. Concentration Curves

Concentration vs. Time - MW-01

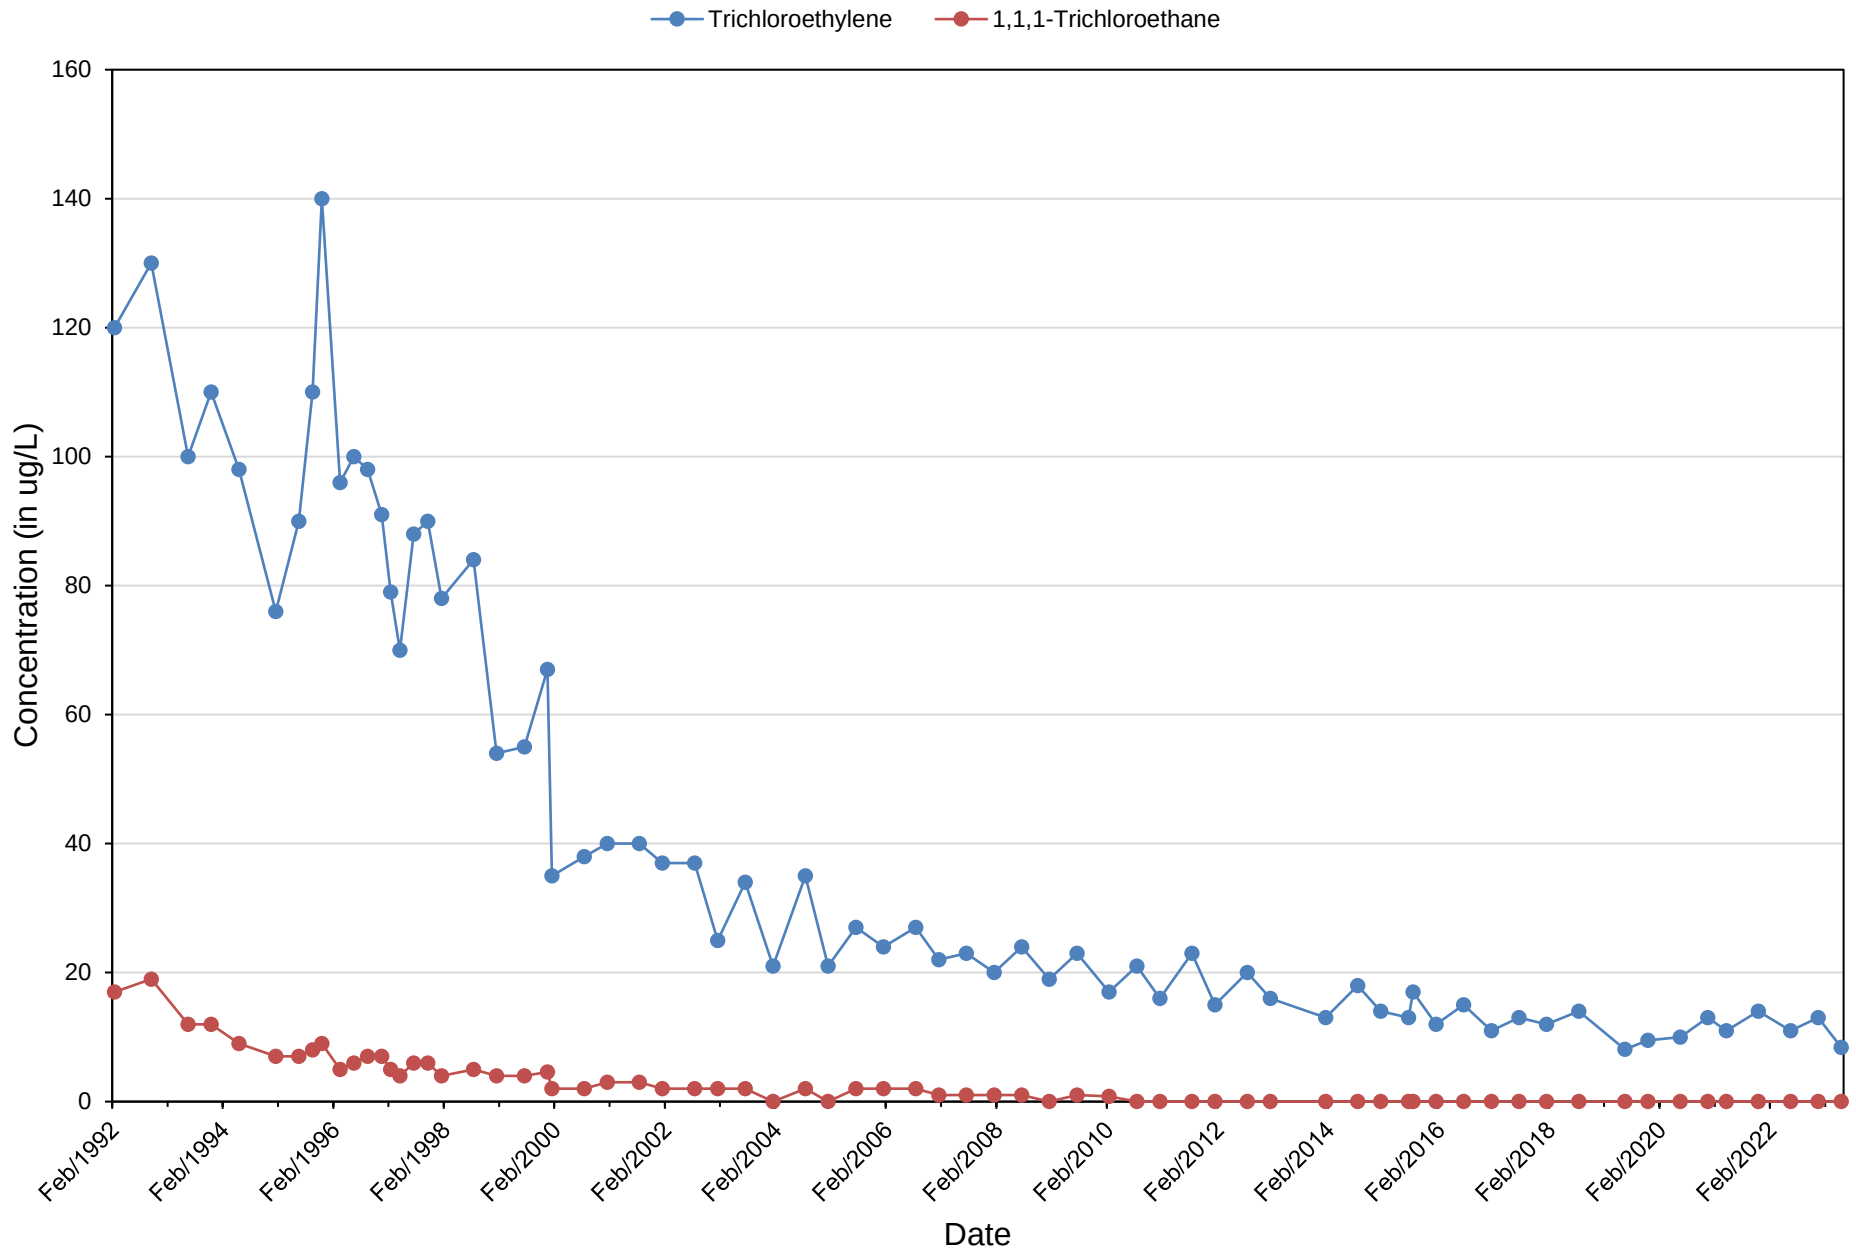


Concentration vs. Time - MW-01DA


Trichloroethylene 1,1,1-Trichloroethane

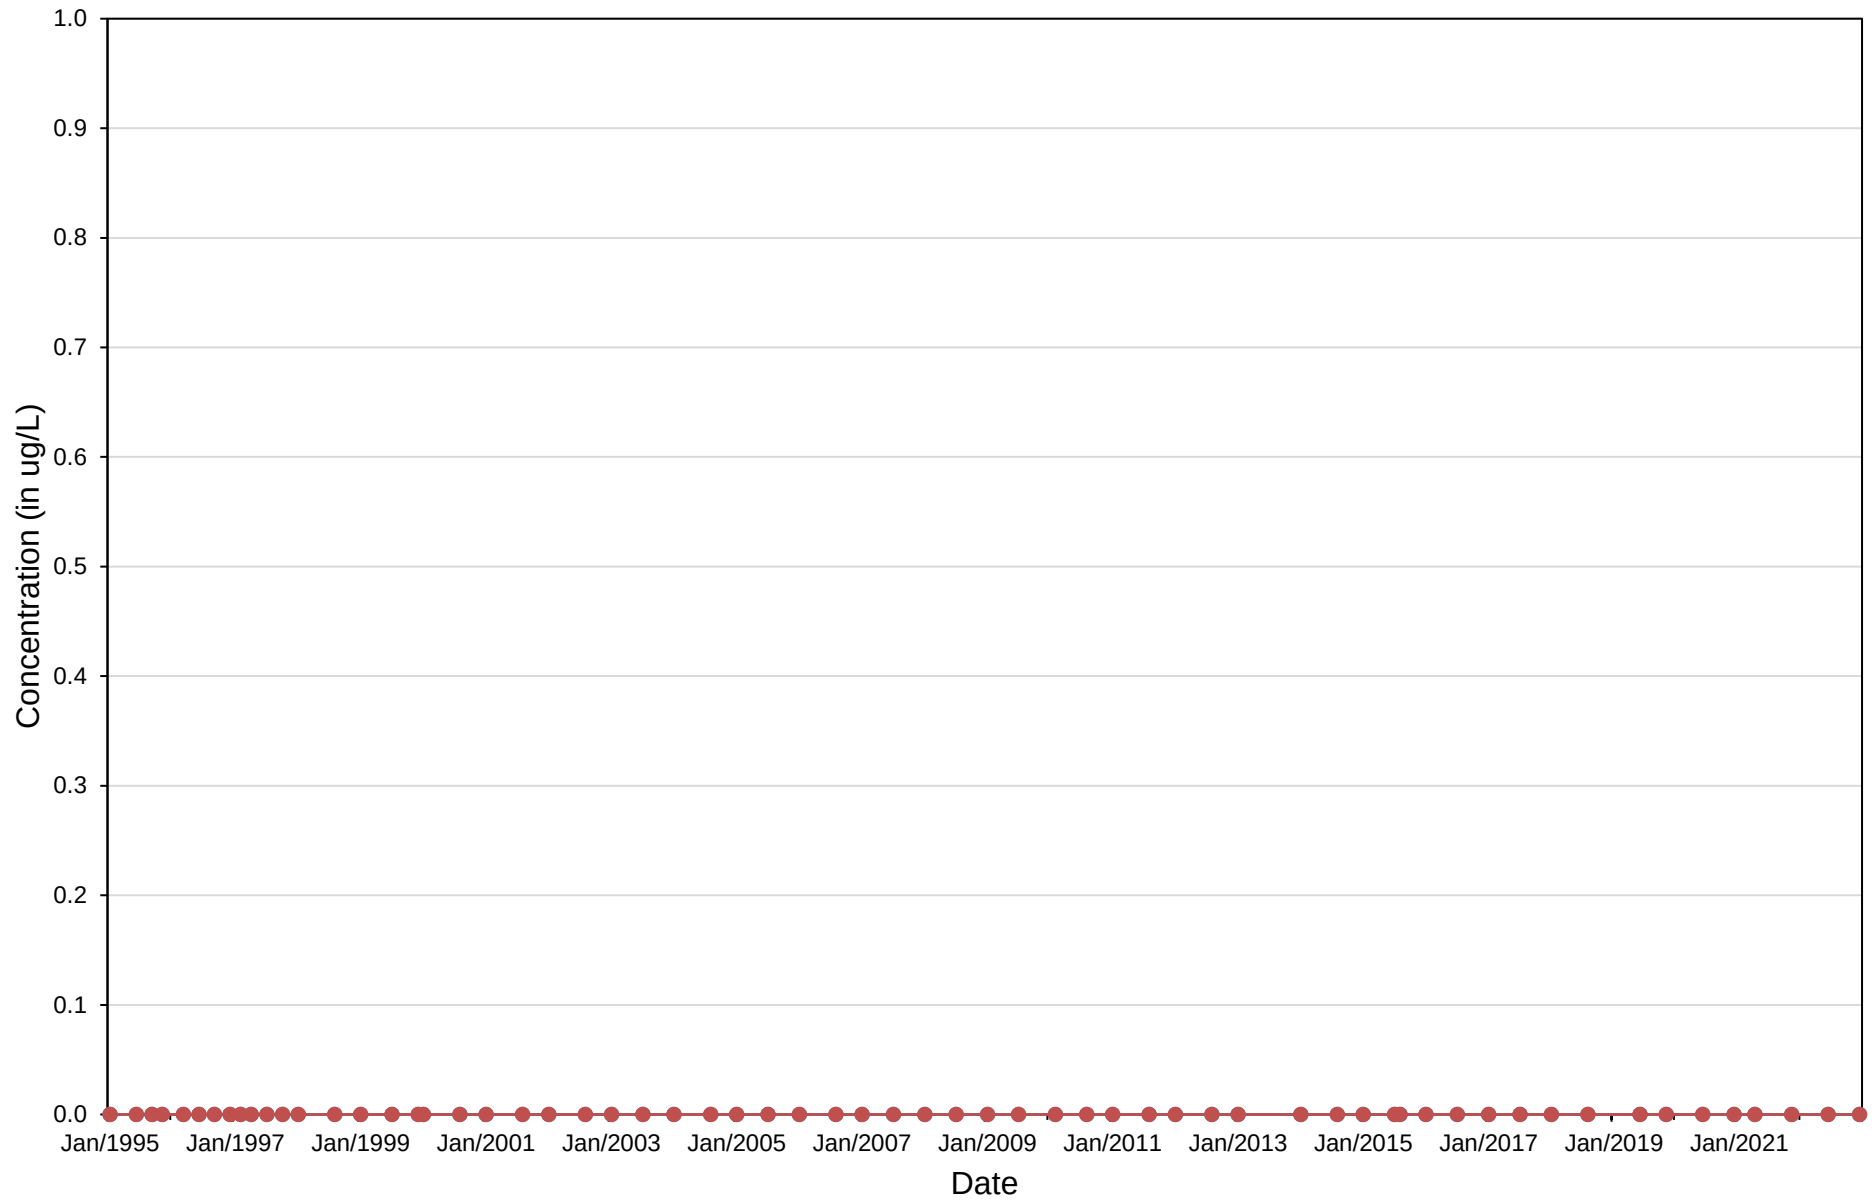

Concentration vs. Time - MW-02A

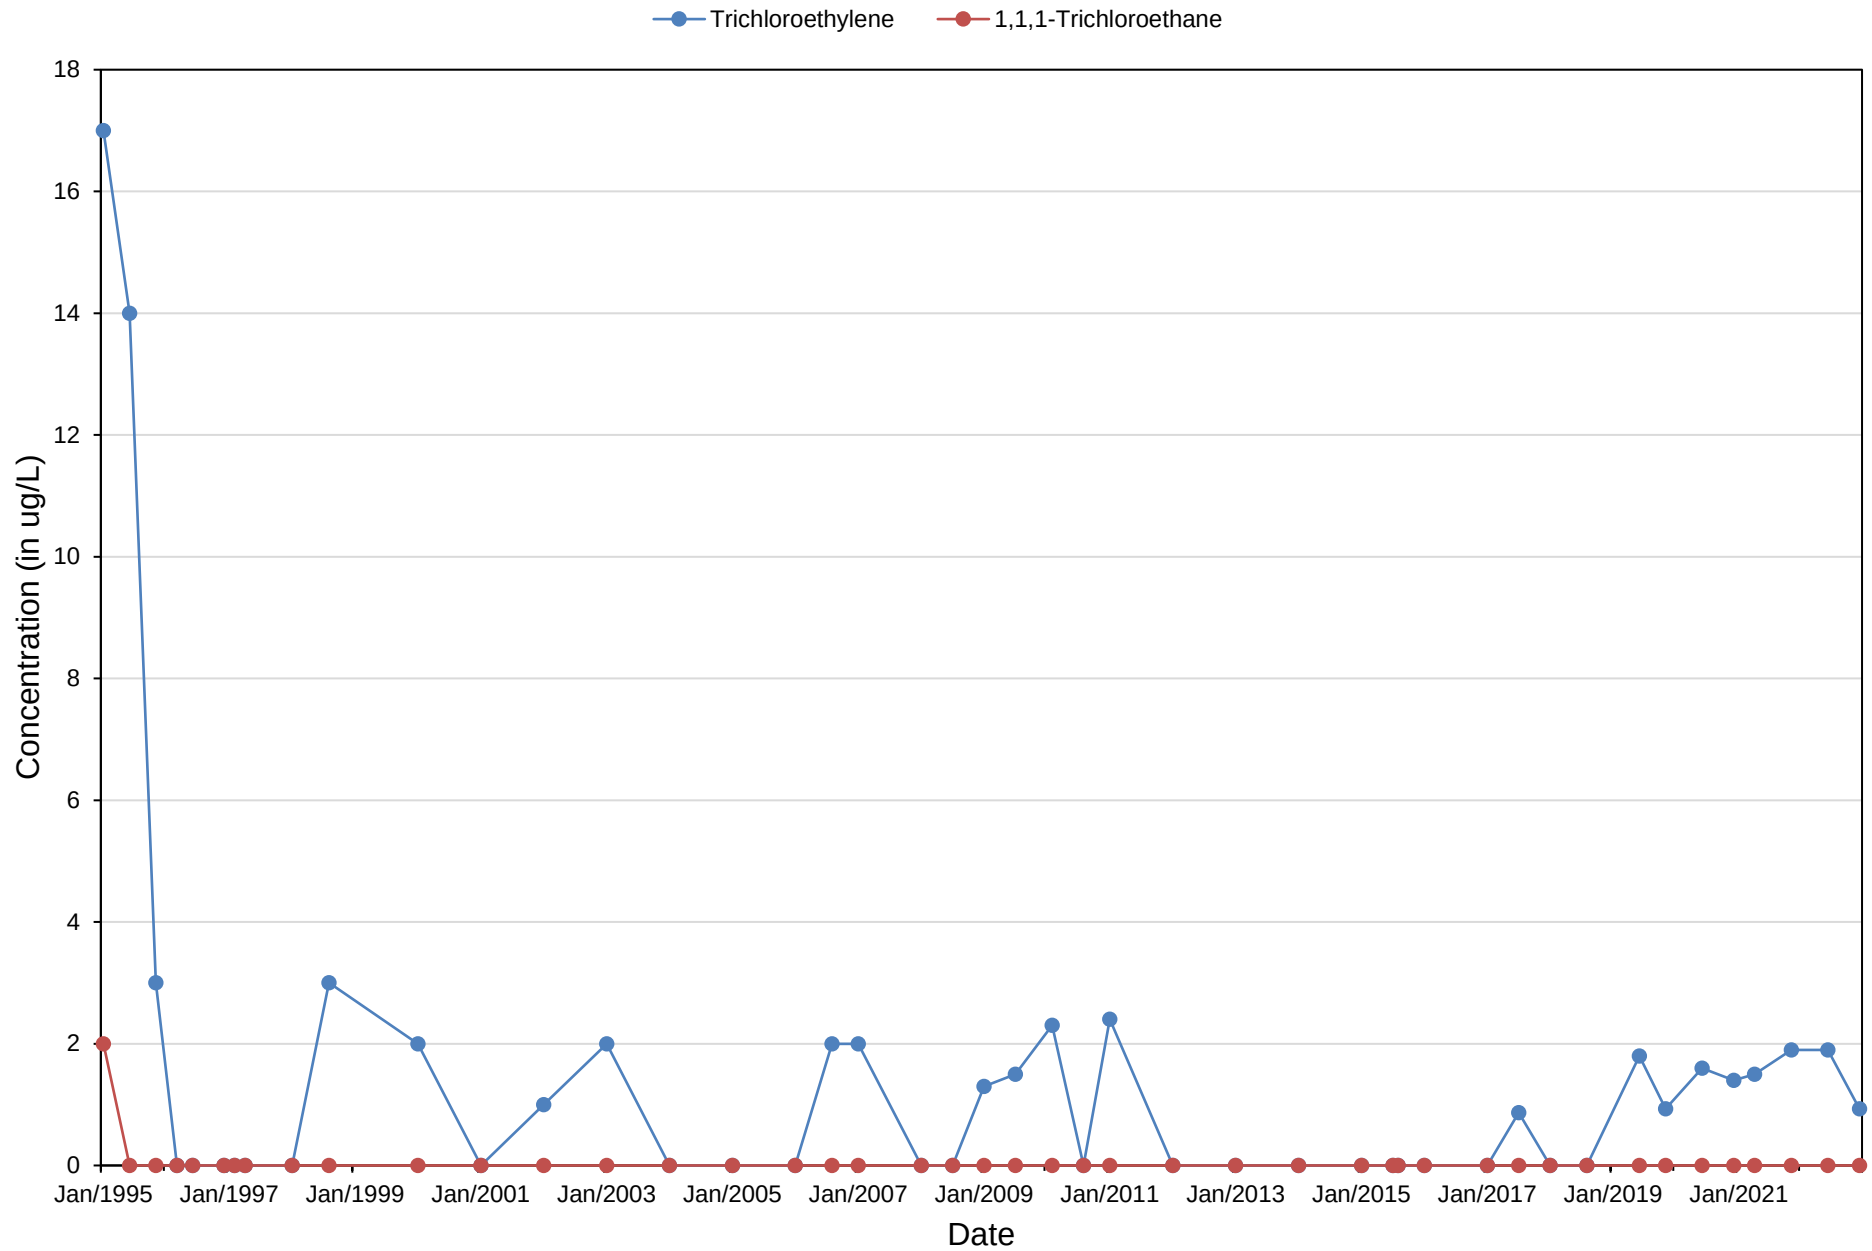


Concentration vs. Time - MW-03

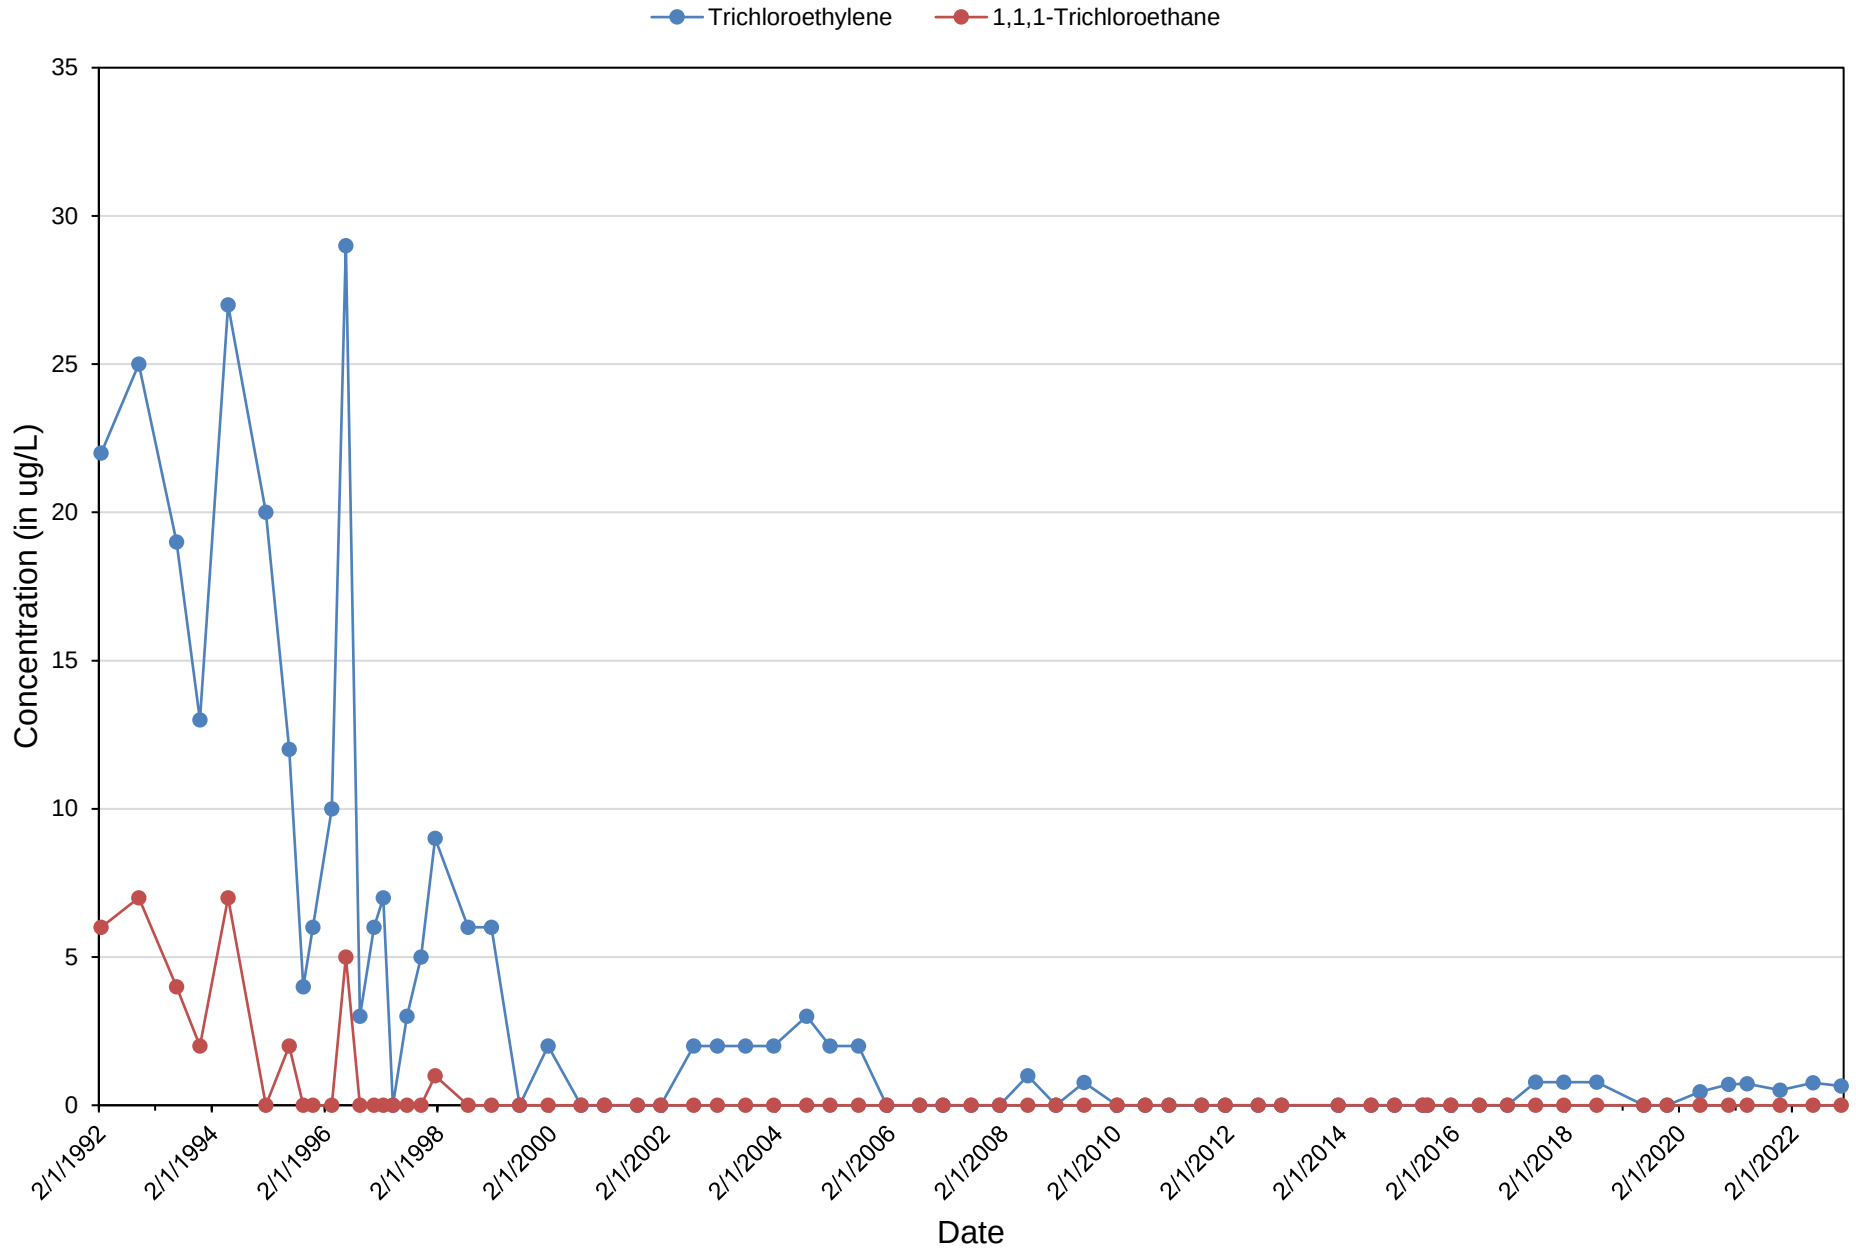


Concentration vs. Time - MW-05


Trichloroethylene 1,1,1-Trichloroethane

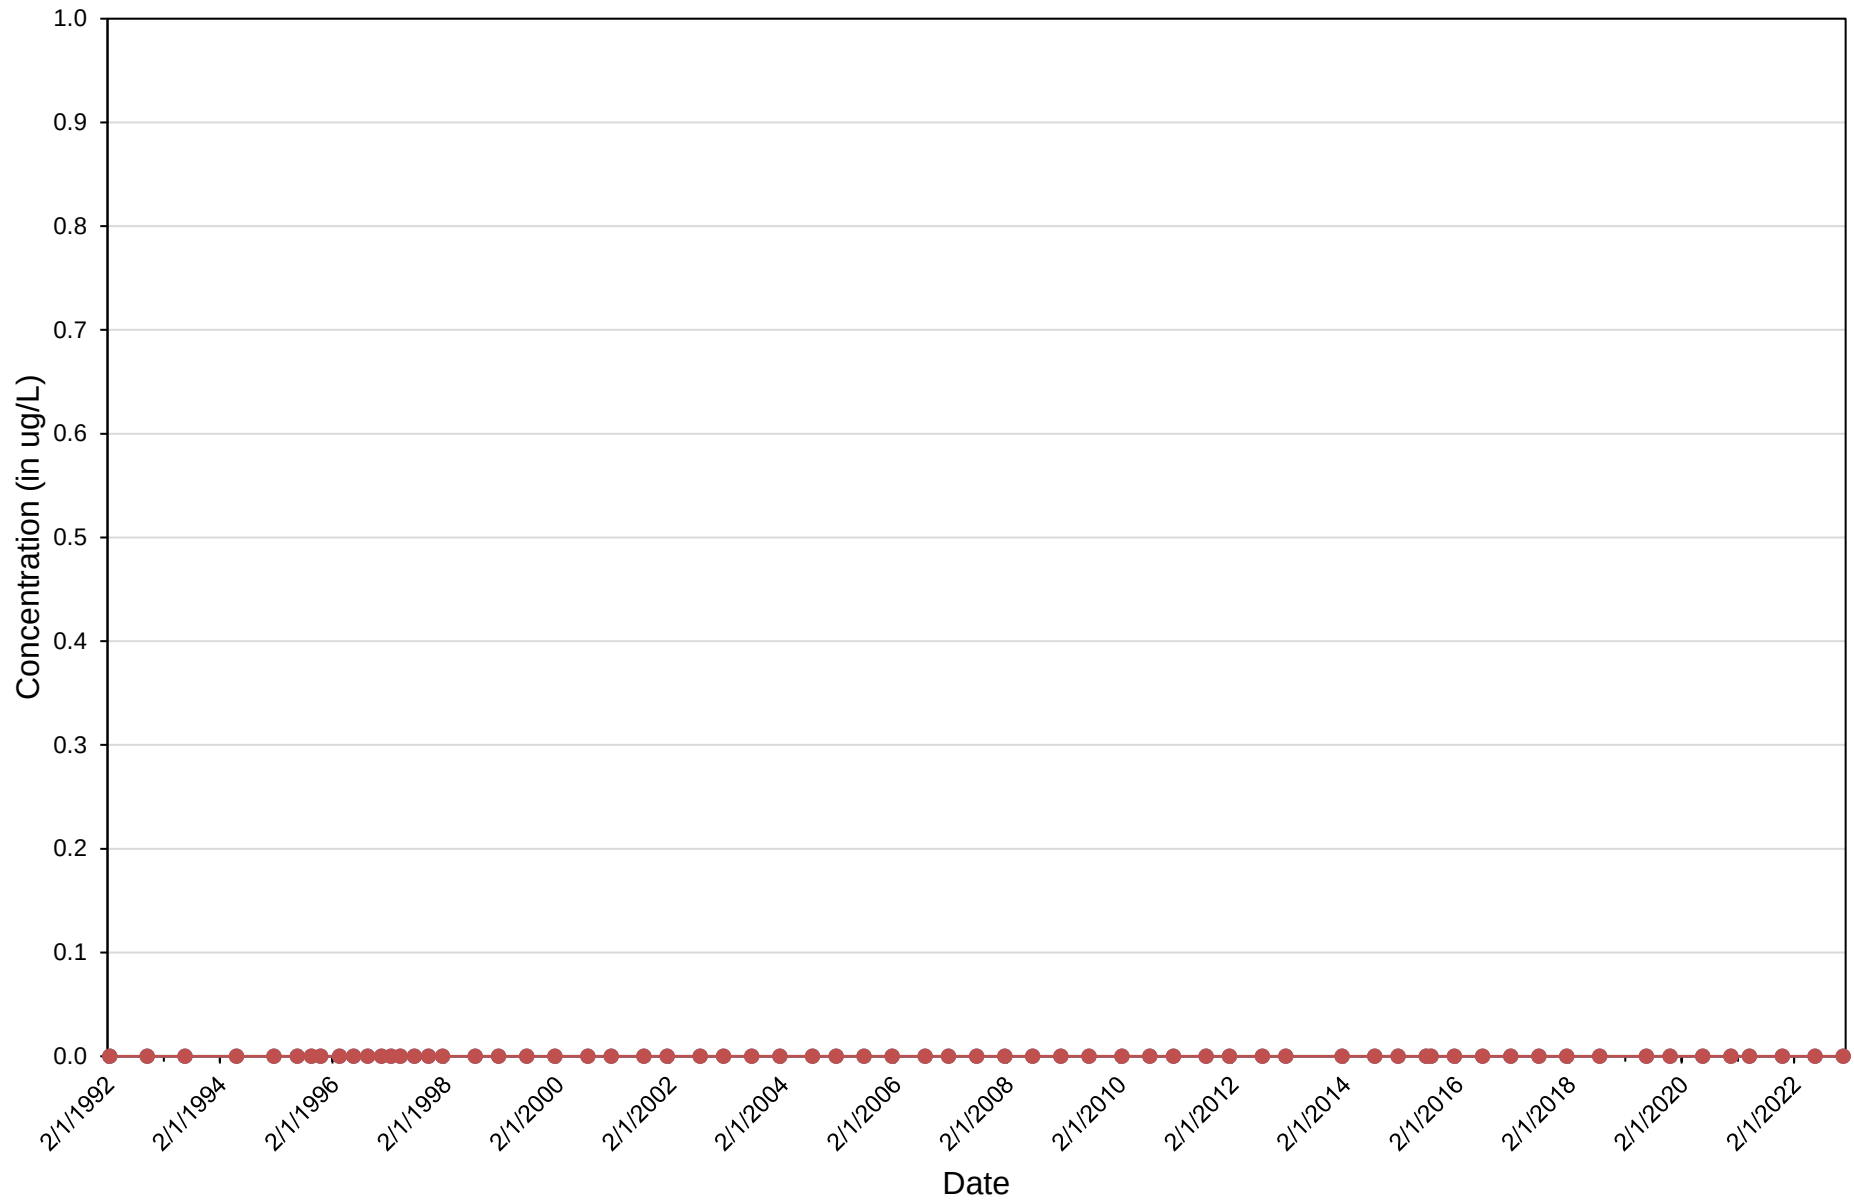


Concentration vs. Time - MW-06A

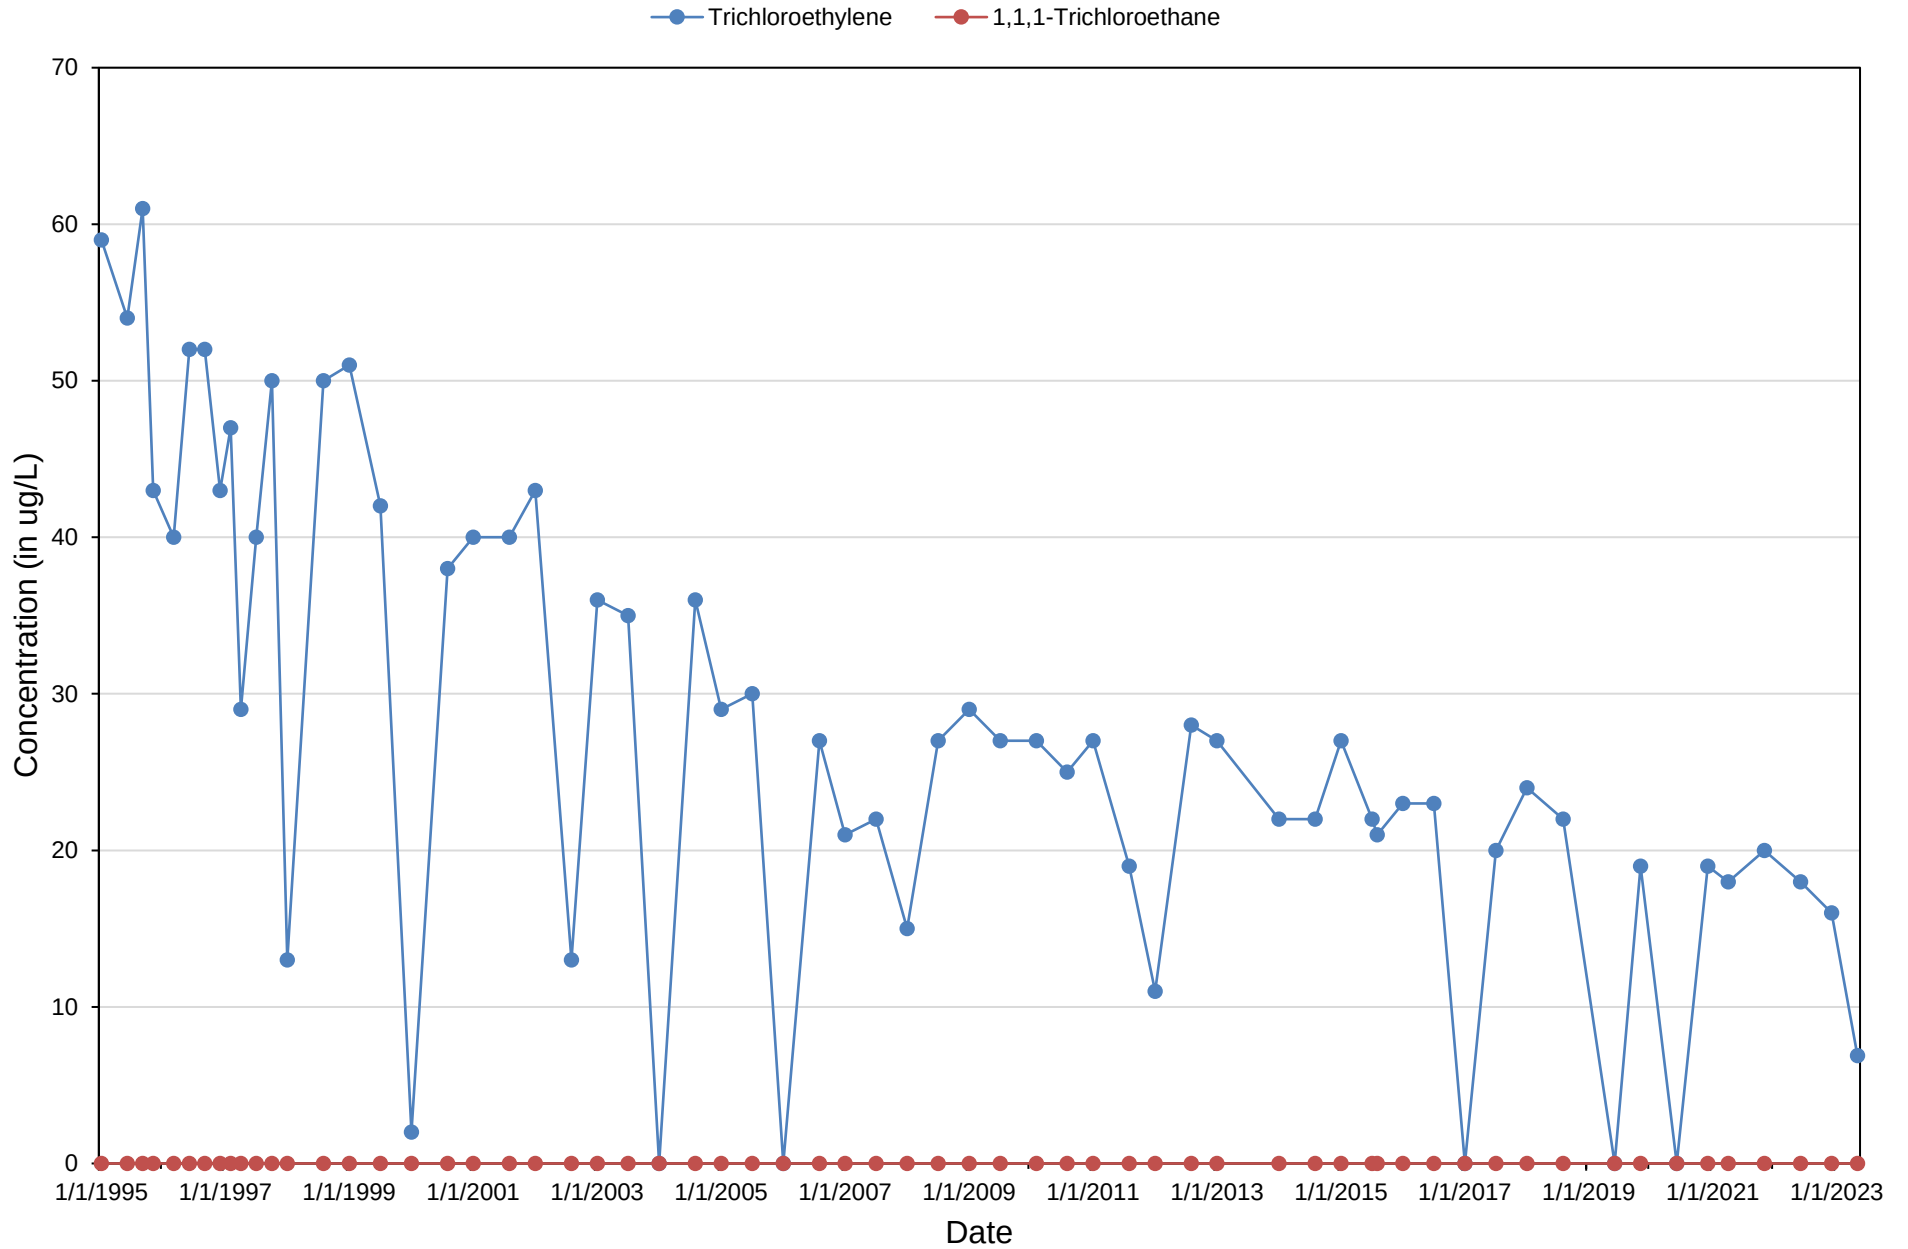


Concentration vs. Time - MW-06DA

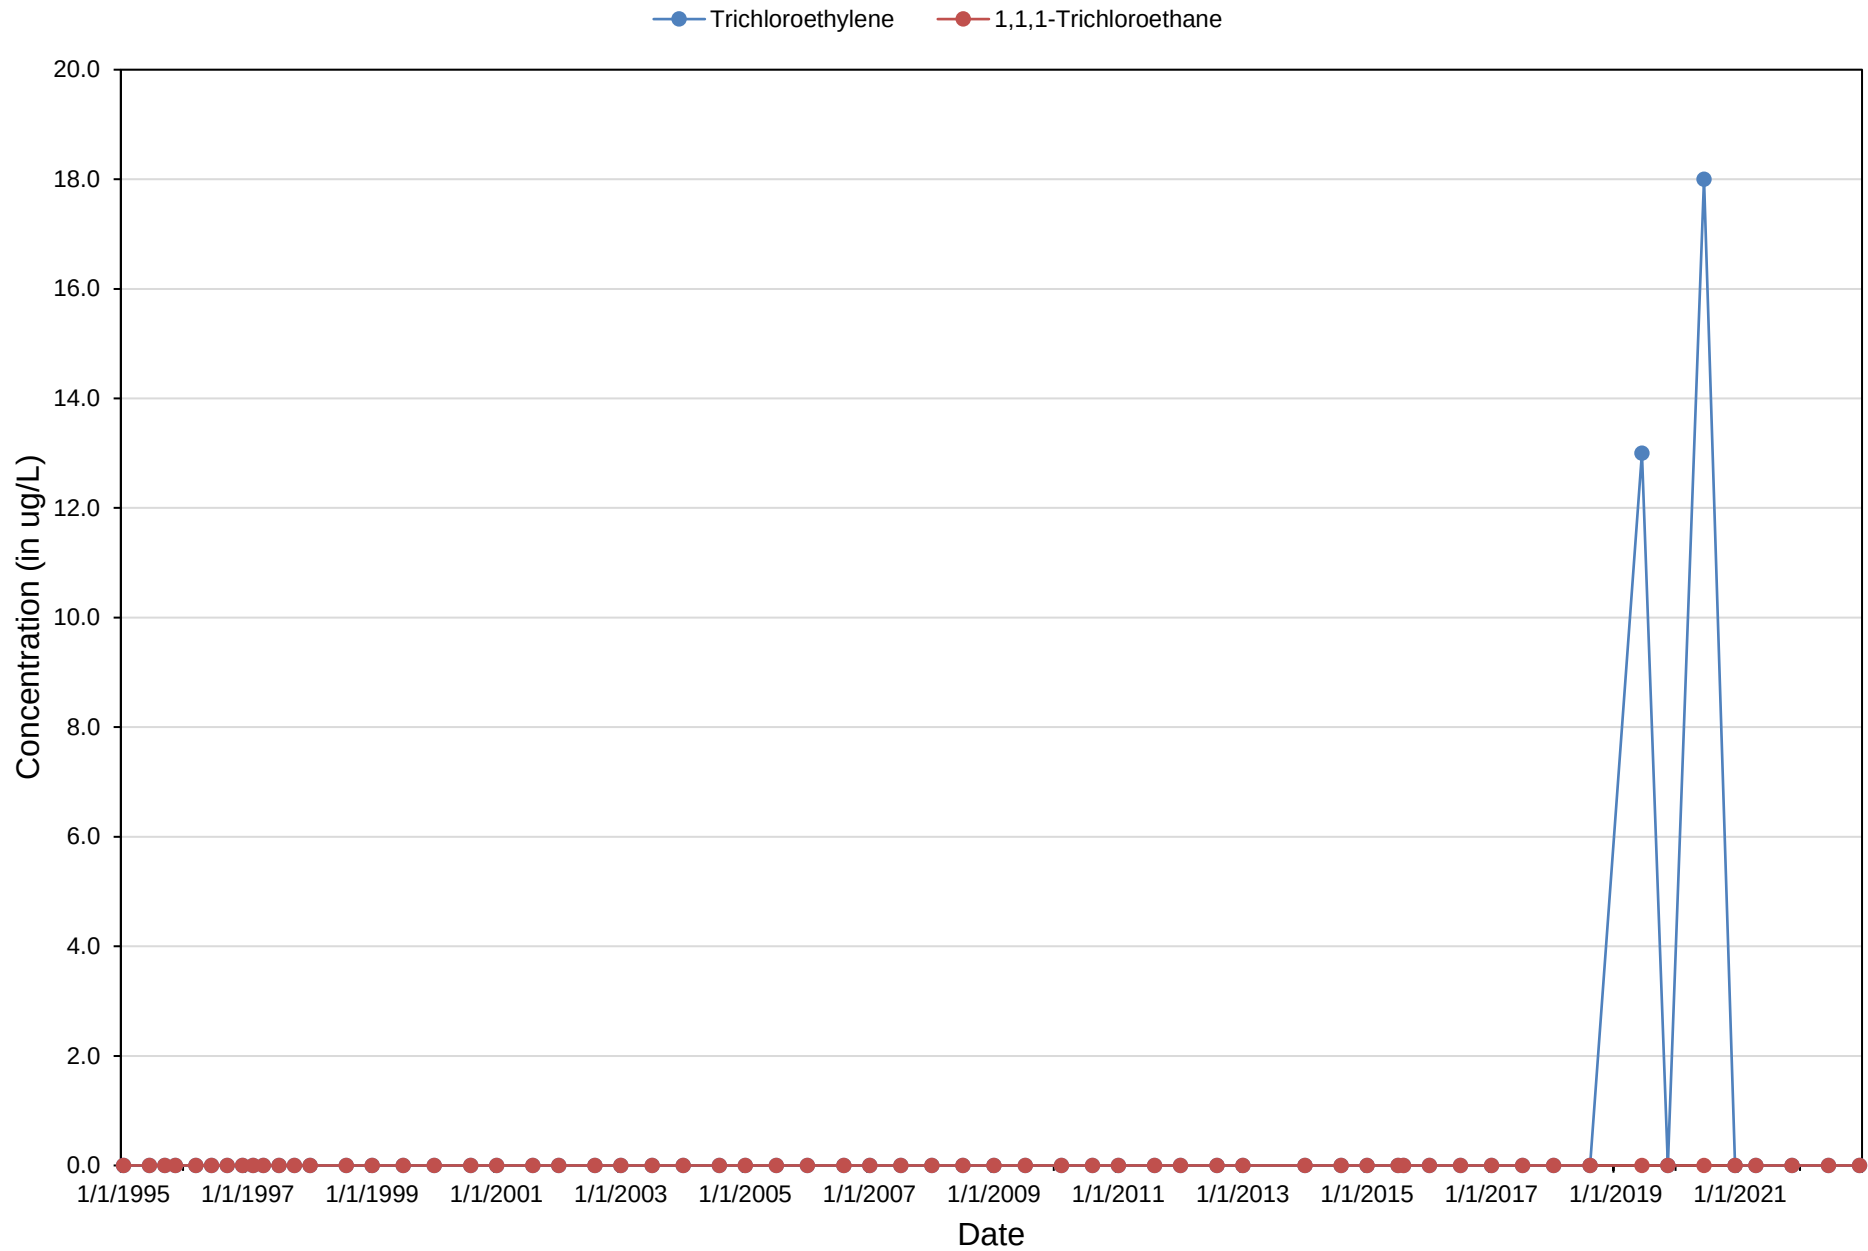


Concentration vs. Time - MW-07

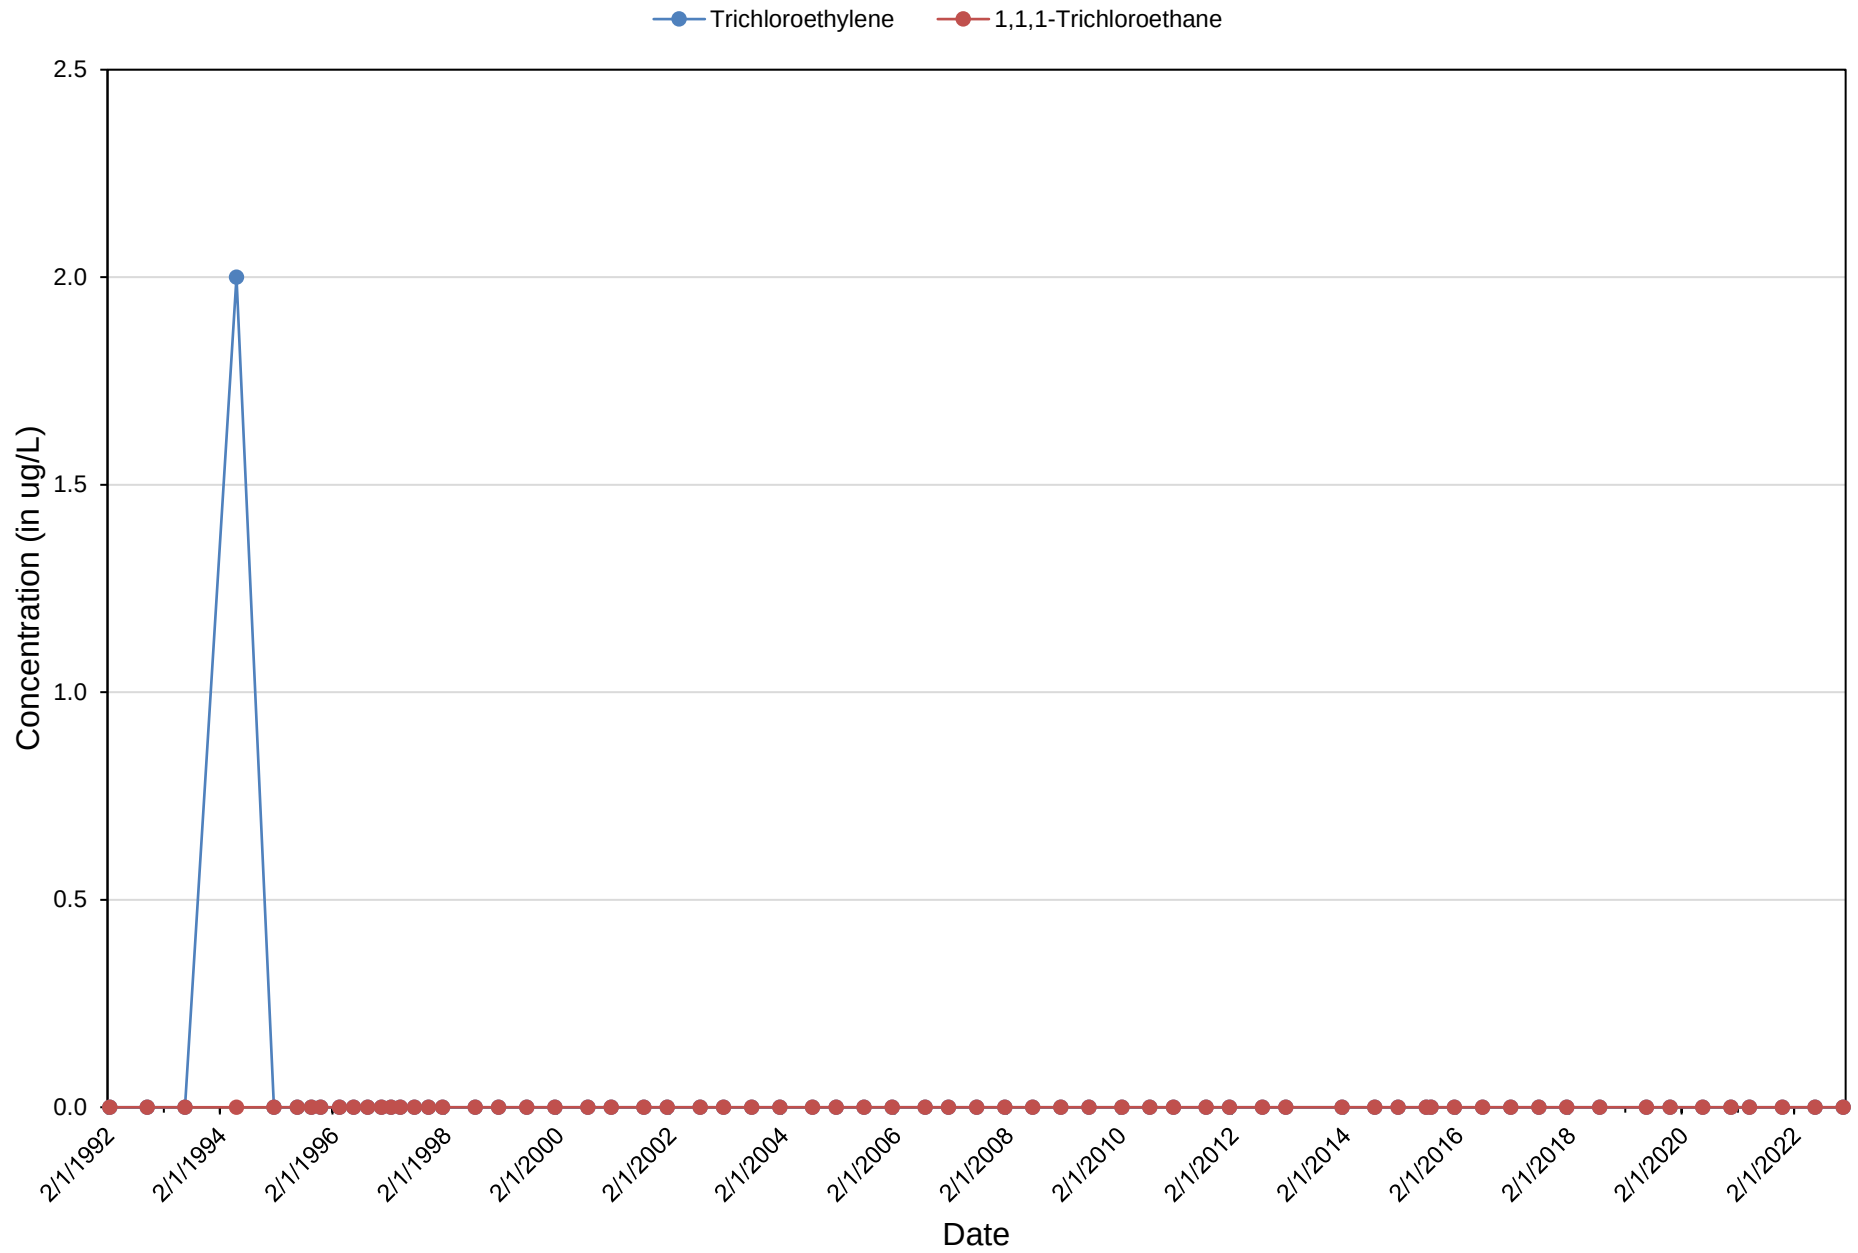


Concentration vs. Time - MW-09

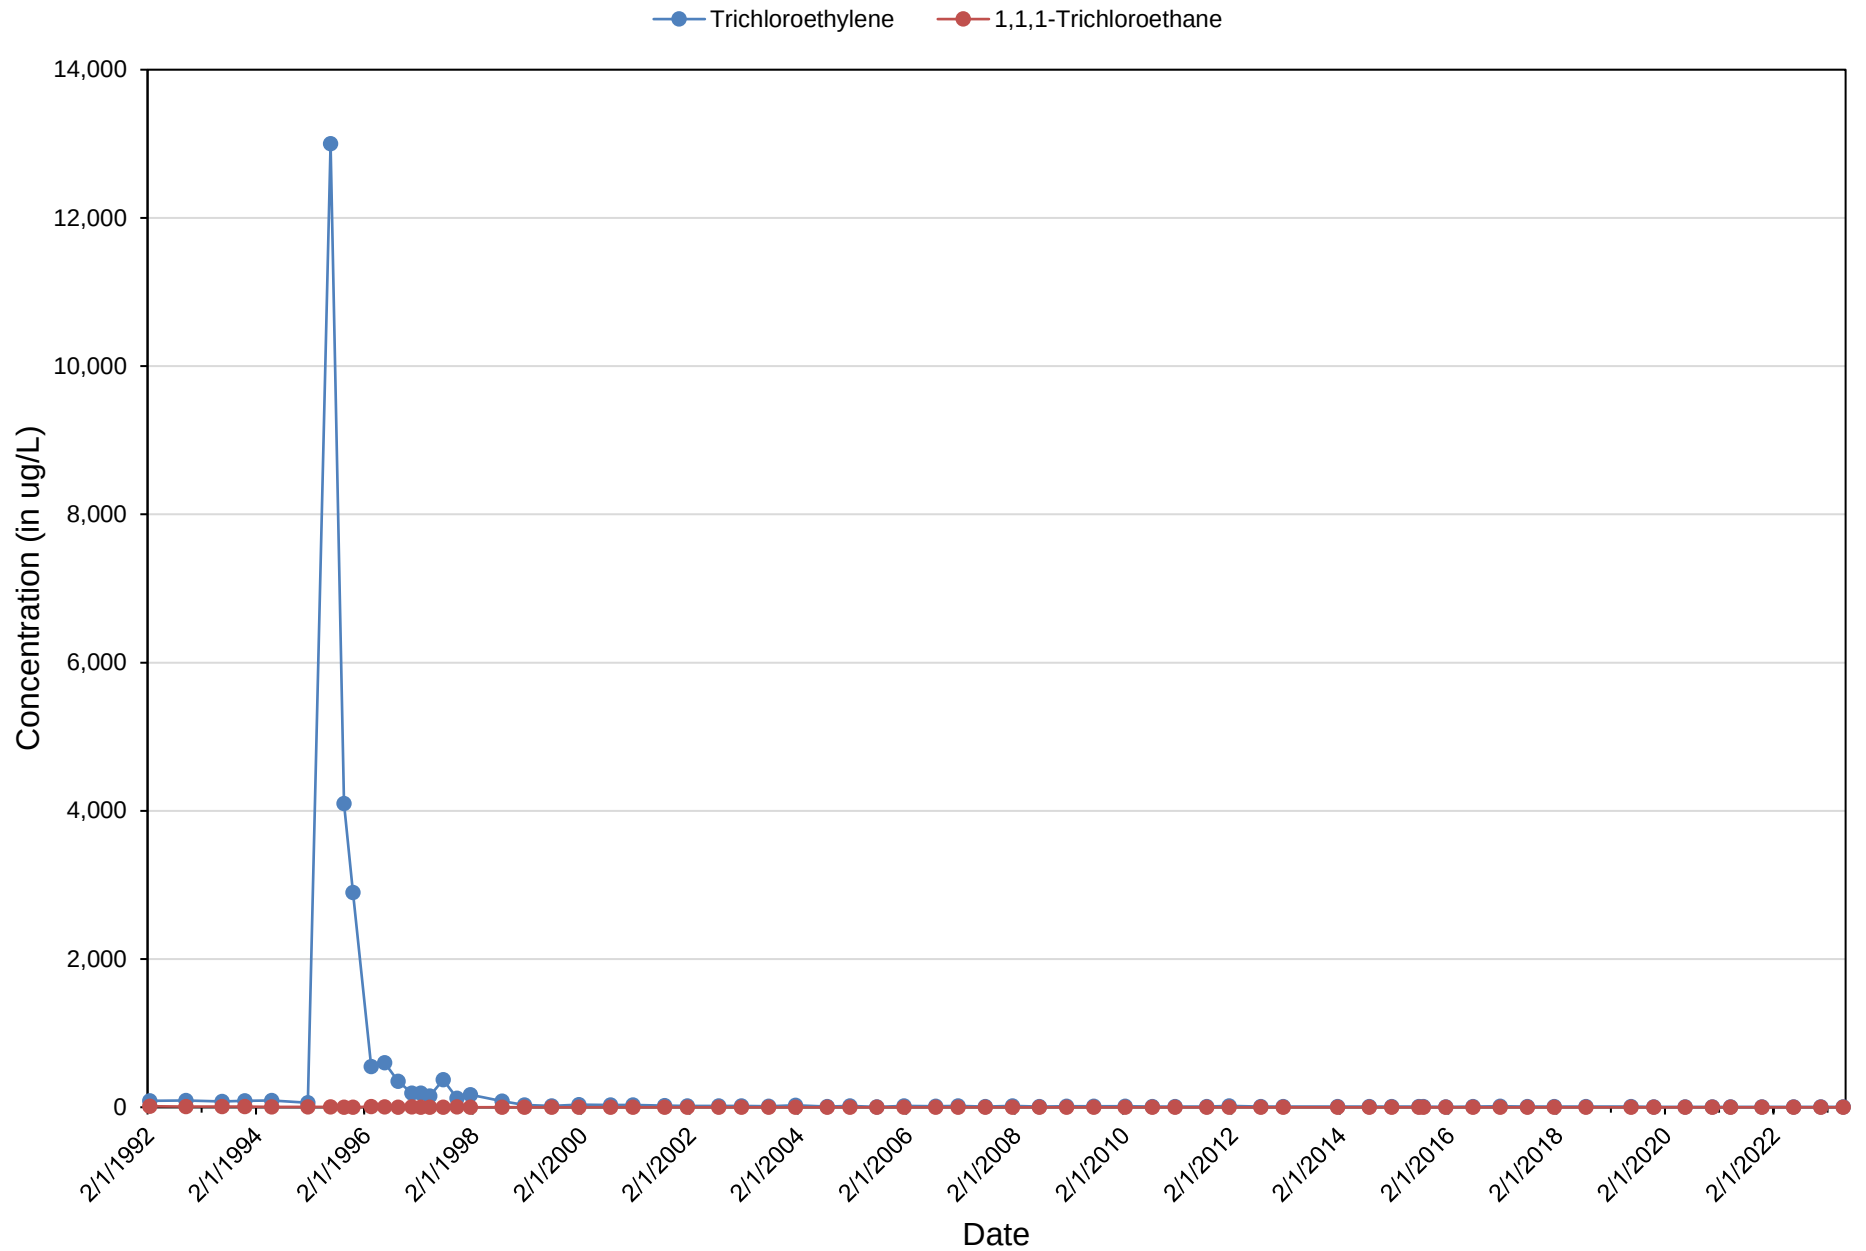


Concentration vs. Time - MW-09D

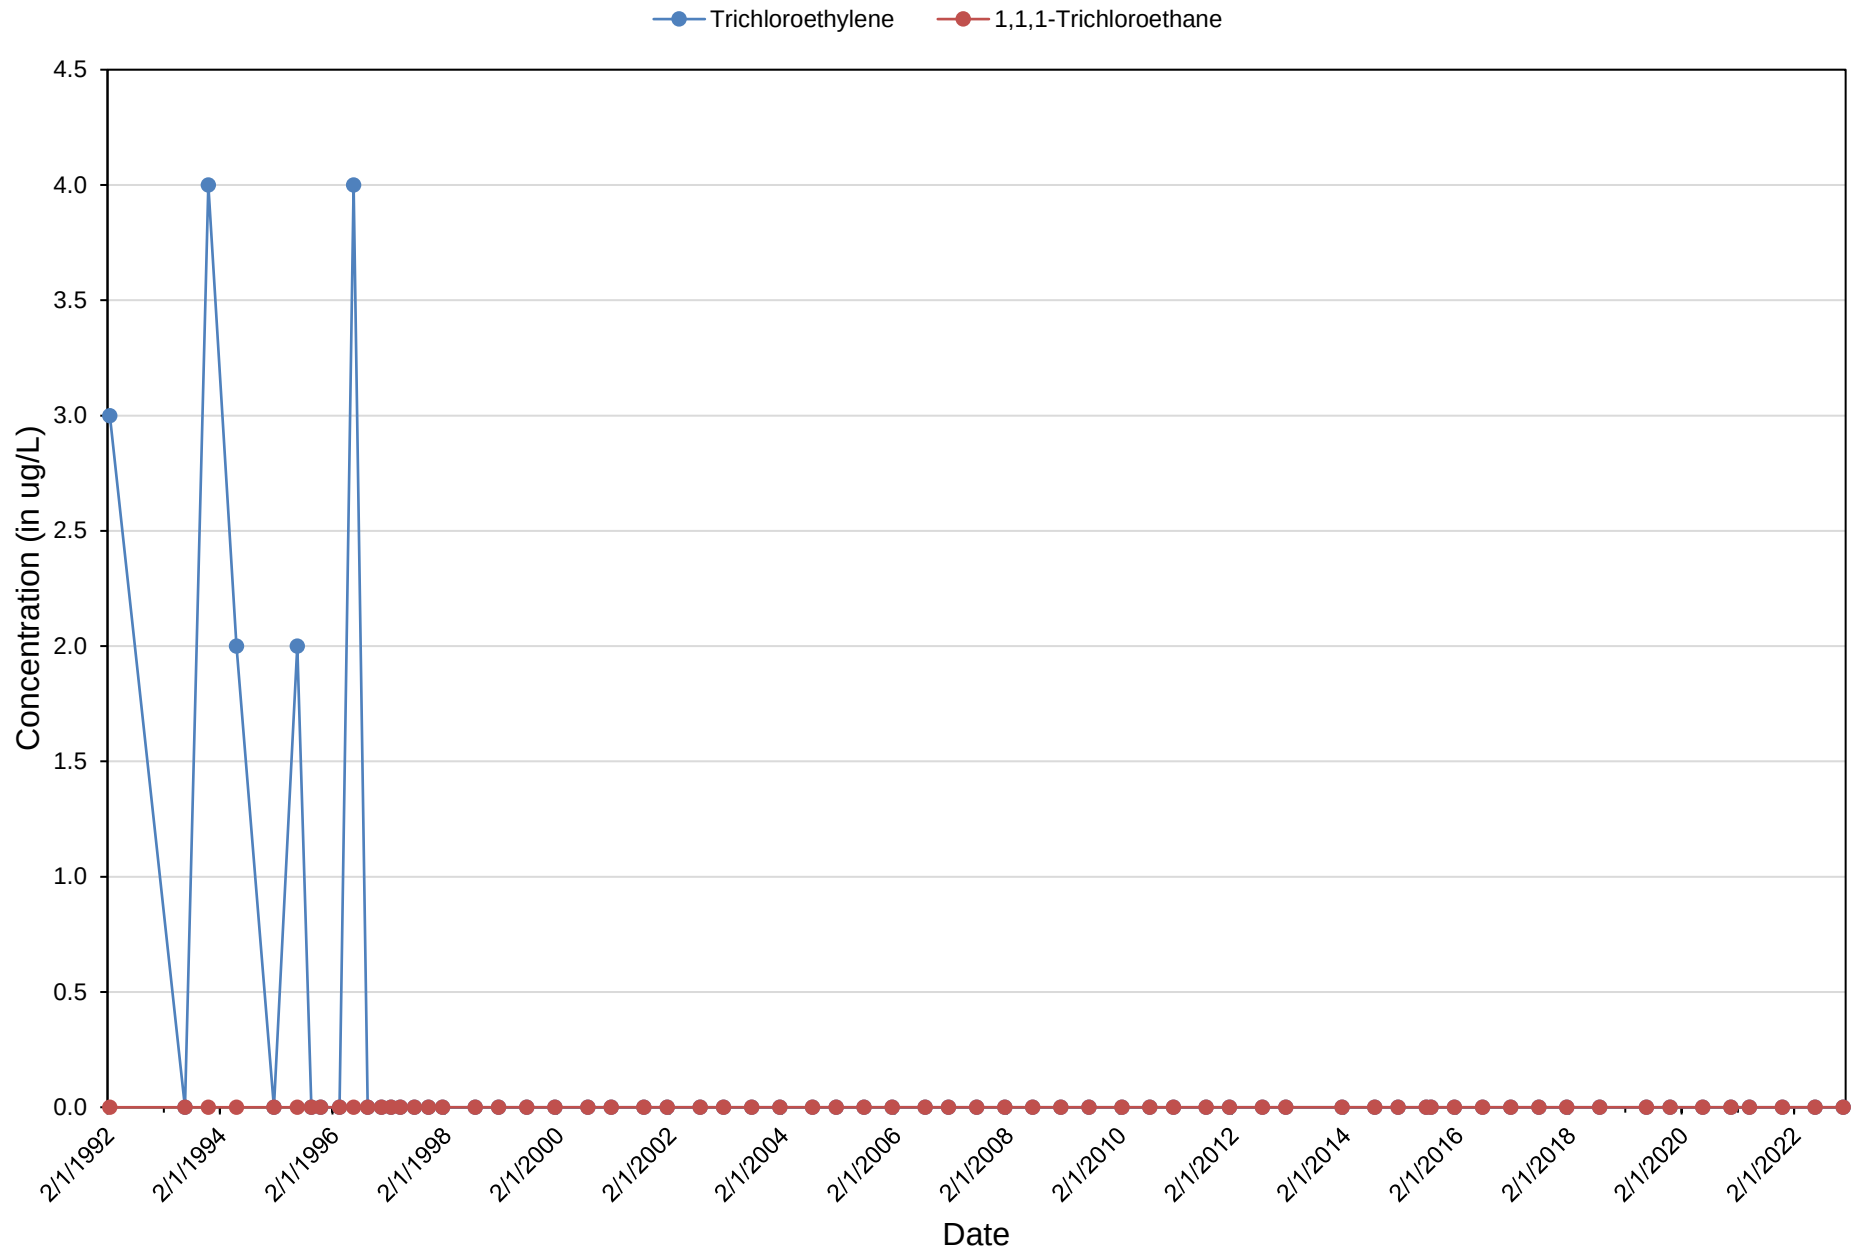


Concentration vs. Time - MW-11

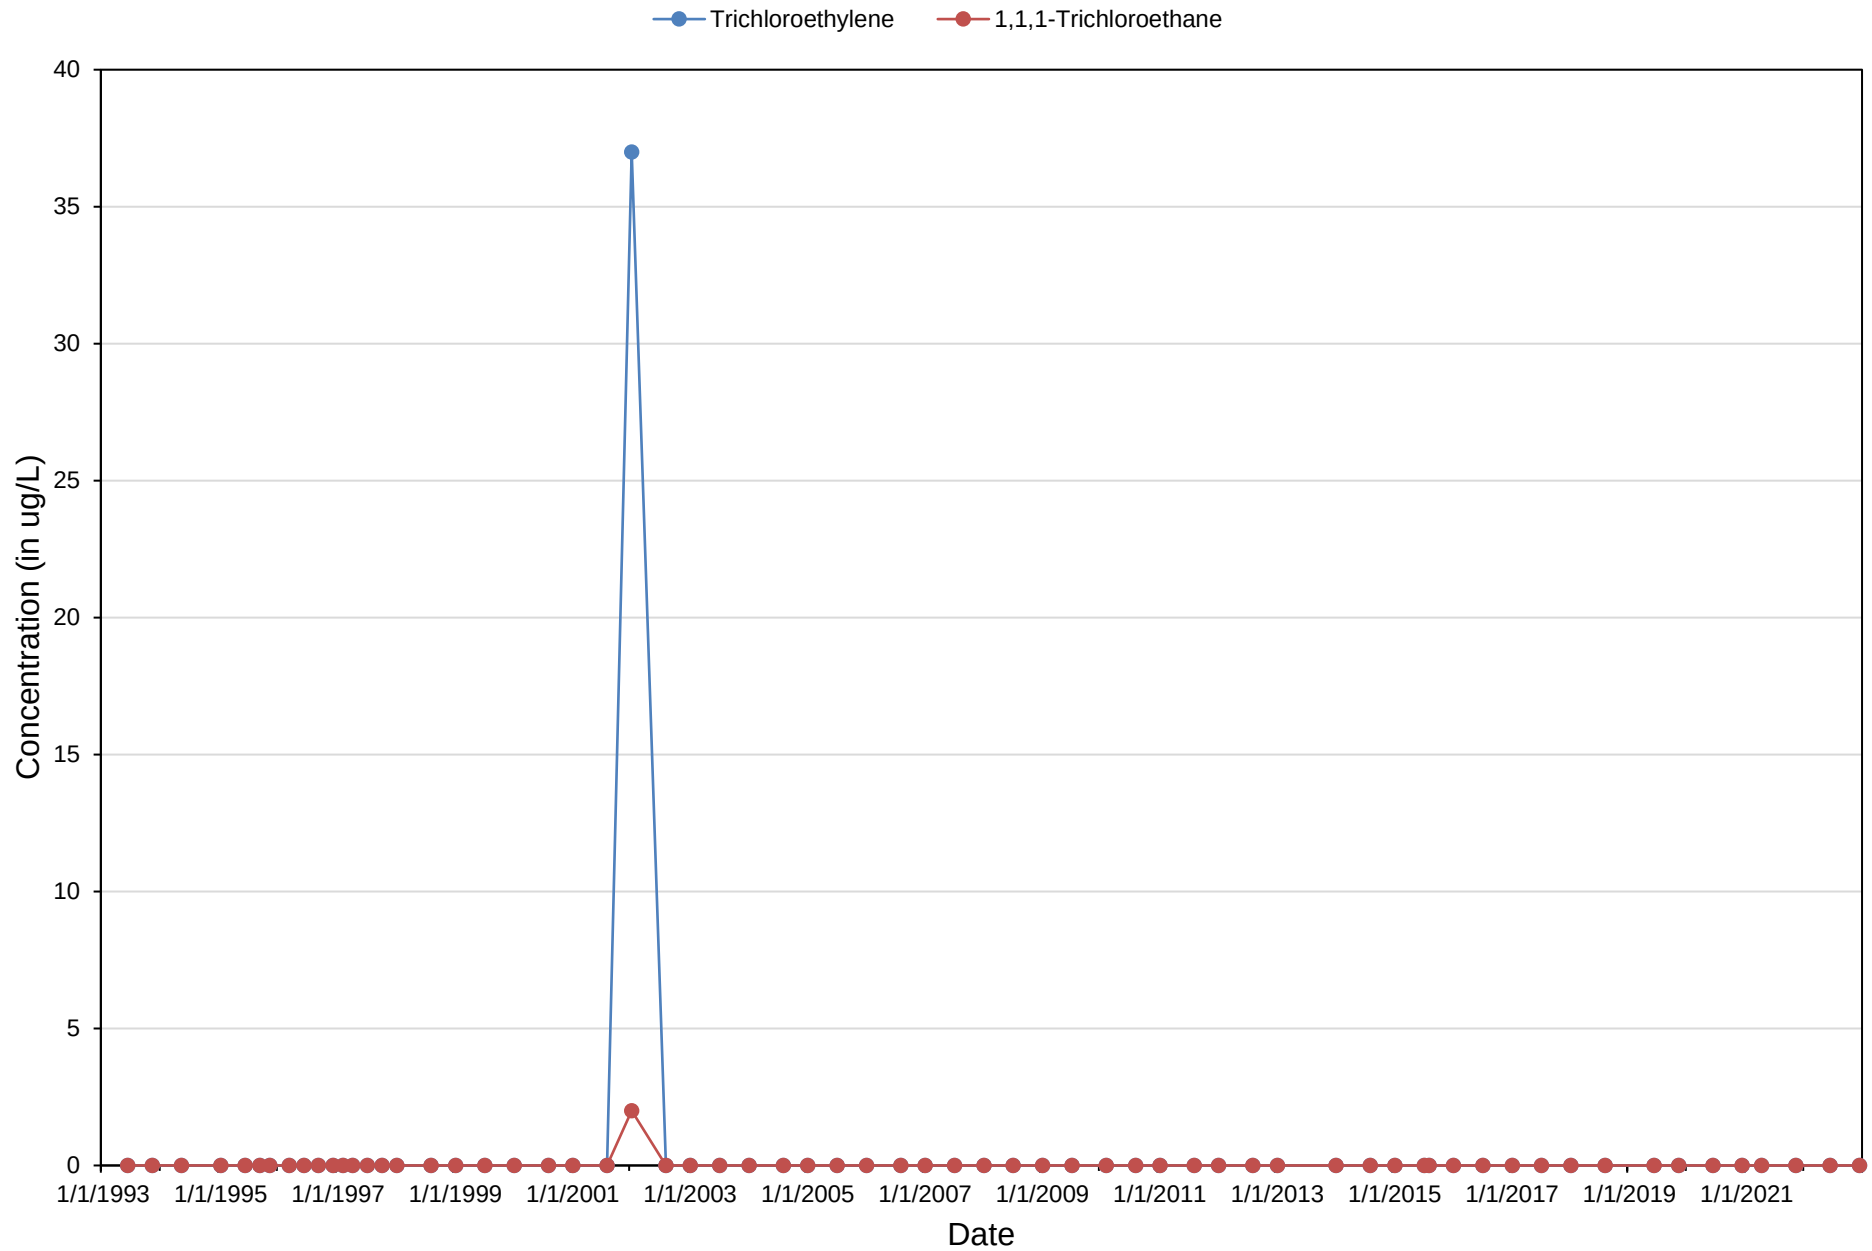

Concentration vs. Time - MW-12

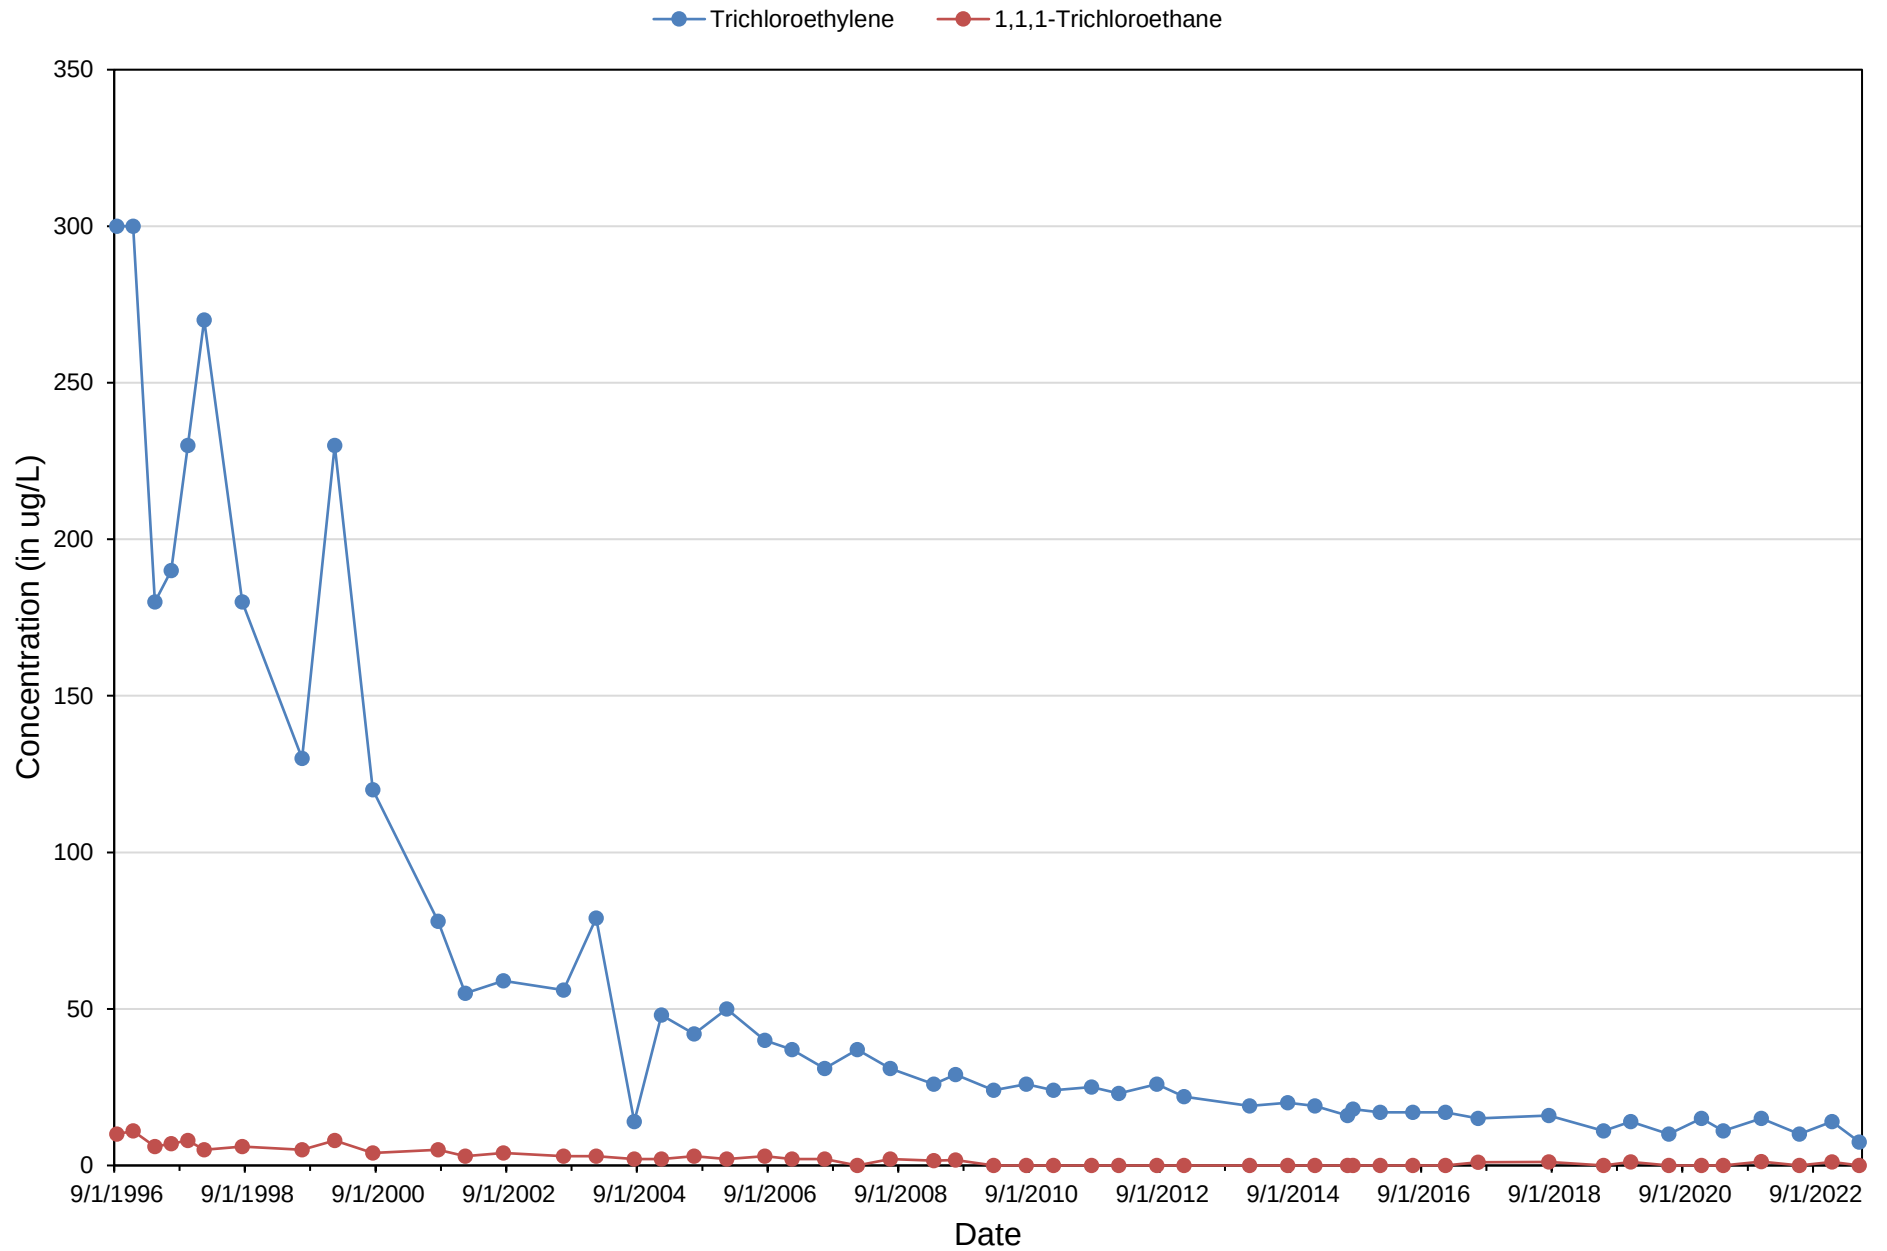


Concentration vs. Time - MW-13

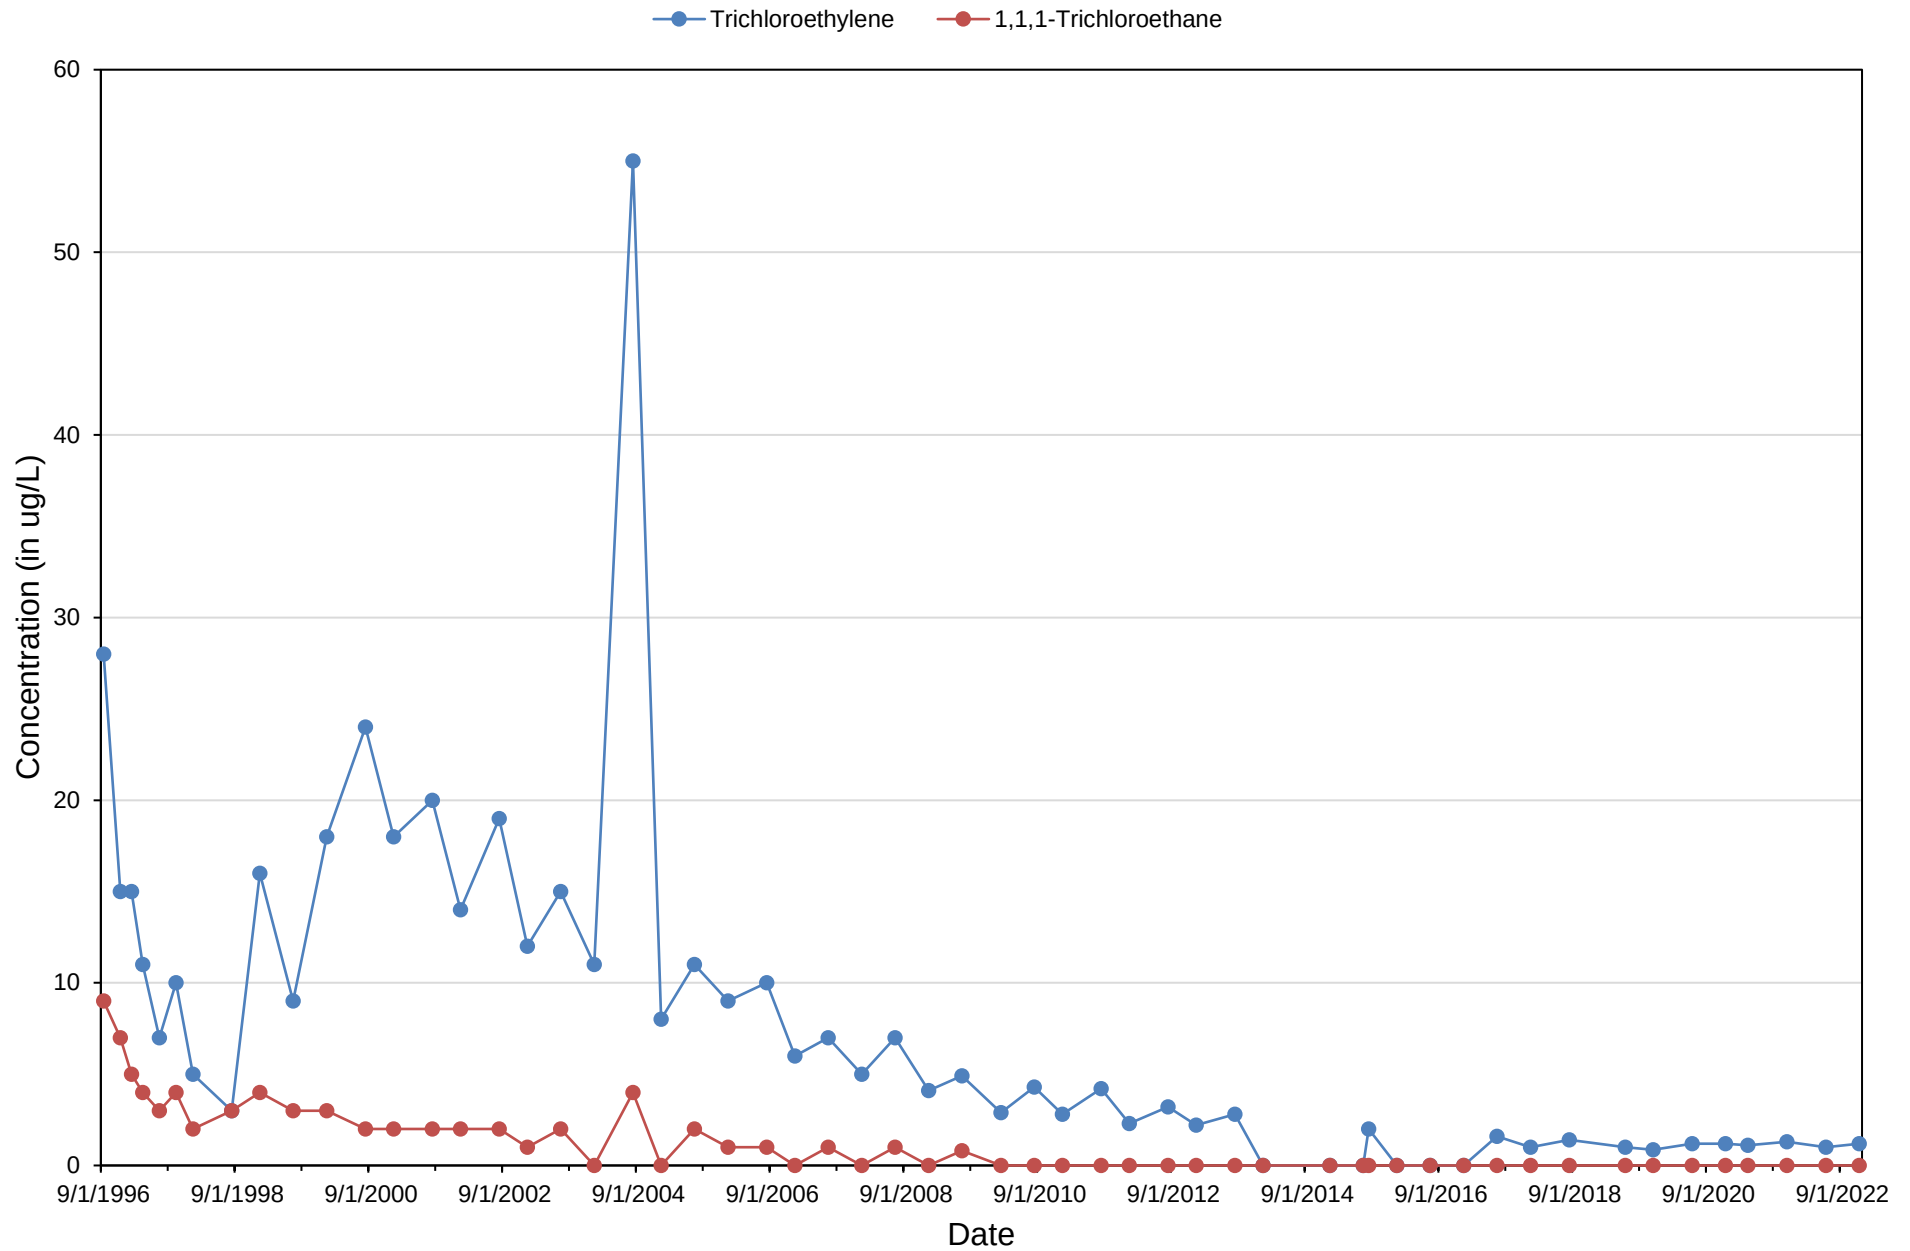

Concentration vs. Time - MW-14

Trichloroethylene 1,1,1-Trichloroethane

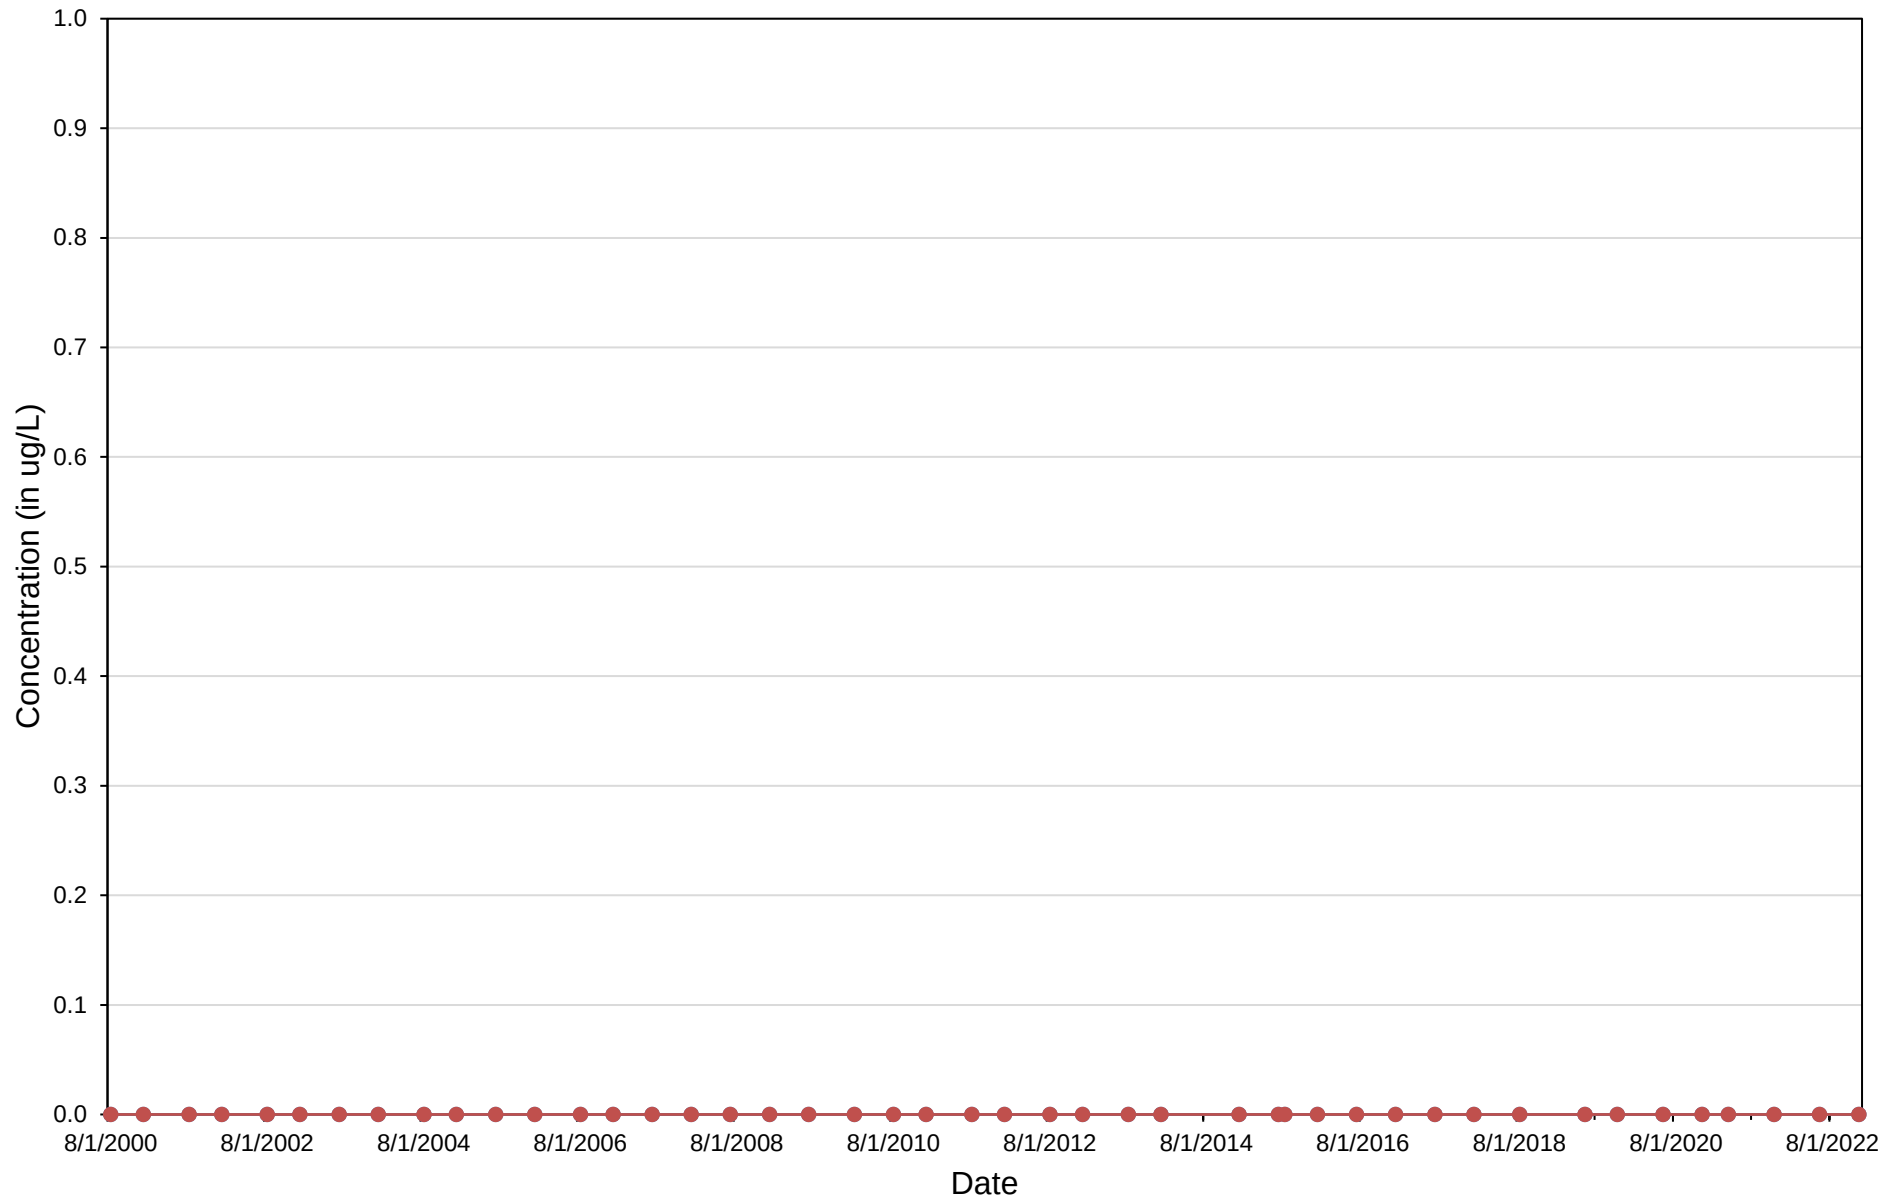

ATTACHMENT 5

IC/EC Annual Certification



Enclosure 2
NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION
Site Management Periodic Review Report Notice
Institutional and Engineering Controls Certification Form



Site No. **961009** **Site Details** **Box 1**

Site Name Prestolite Plant Site

Site Address: 400 Main Street Zip Code: 14009
City/Town: Arcade
County: Wyoming
Site Acreage: 22.000

Reporting Period: July 15, 2022 to July 15, 2023

- | | YES | NO |
|--|-------------------------------------|-------------------------------------|
| 1. Is the information above correct? | ☒ | ☐ |
| If NO, include handwritten above or on a separate sheet. | | |
| 2. Has some or all of the site property been sold, subdivided, merged, or undergone a tax map amendment during this Reporting Period? | ☐ | ☒ |
| 3. Has there been any change of use at the site during this Reporting Period (see 6NYCRR 375-1.11(d))? | ☐ | ☒ |
| 4. Have any federal, state, and/or local permits (e.g., building, discharge) been issued for or at the property during this Reporting Period? | ☐ | ☒ |
| If you answered YES to questions 2 thru 4, include documentation or evidence that documentation has been previously submitted with this certification form. | | |
| 5. Is the site currently undergoing development? | ☐ | ☒ |

- | | YES | NO |
|--|-------------------------------------|--------------------------|
| 6. Is the current site use consistent with the use(s) listed below?
Commercial and Industrial | ☒ | ☐ |
| 7. Are all ICs in place and functioning as designed? | ☒ | ☐ |

**IF THE ANSWER TO EITHER QUESTION 6 OR 7 IS NO, sign and date below and
DO NOT COMPLETE THE REST OF THIS FORM. Otherwise continue.**

A Corrective Measures Work Plan must be submitted along with this form to address these issues.

Signature of Owner, Remedial Party or Designated Representative

Date

Description of Institutional ControlsParcel**183.13-2-14.1**Owner

Prestolite Electric, Inc.

Institutional Control

Landuse Restriction
Ground Water Use Restriction
Monitoring Plan

O&M Plan

Per Declaration of Covenants and Restrictions (Filed with Wyoming County Clerk on April 24, 2001):

1. The Order is binding upon Motorola and Prestolite.
2. This Declaration shall run with the Property and to the benefit of NYSDEC, and shall be binding upon all future owners of the portions of the Property affected by this Declaration, and upon each and every tenant, subtenant, invitee and licensee of thereof, and cannot be modified without the consent of the NYSDEC (or any New York State Department, Bureau or other entity replacing NYSDEC).
3. The Property, having been listed by NYSDEC as a Class 3 Site in the Registry of Inactive Hazardous Waste Disposal Sites in New York State, is subject to applicable restrictions on the use of the Property, including those specified by § 375-1.2(c) of the Environmental Conservation regulations embodied in Title 6 of the New York Code of Rules and Regulations. Use of the Property is thereby limited such that no person may engage in any activity:
 - (a) that will, or that is reasonably anticipated to, prevent to interfere significantly with any proposed, ongoing or completed remedial program affecting the Property, including any activity that will intrude into waste materials or will otherwise diminish the effectiveness of the remedy, or
 - (b) that will, or is reasonably likely to, expose the public health or the environment to a significantly increased threat of harm or damage to the Property.

In addition, (i) there shall be no wells drilled into any groundwater aquifer(s) beneath the Property and (ii) with respect to the portion of the Property lying southwest of the railroad tracks which includes the "wastewater treatment plant" and the "former chemical storage building" (as depicted on the Site Plan attached hereto as Exhibit "B") there shall be no construction of new buildings, and any utility work shall be done in accordance with health and safety plans approved by NYSDEC. Except in emergency situations as determined by the applicable utility company, NYSDEC shall be provided with reasonable prior notice of any proposed utility work in these affected portions of the Property.
4. Use of the Property may be further restricted by applicable law and/or by other orders issued or to be issued according to applicable law.
5. Any deed of conveyance of the Property is subject to and encumbered by this Declaration.

In addition to the above-cited controls required under the Declaration of Covenants and Restrictions, operation and maintenance of the Site's Soil Vapor Mitigation System is required.

Description of Engineering ControlsParcel**183.13-2-14.1**Engineering Control

Vapor Mitigation
Cover System
Monitoring Wells

Periodic Review Report (PRR) Certification Statements

1. I certify by checking "YES" below that:

- a) the Periodic Review report and all attachments were prepared under the direction of, and reviewed by, the party making the Engineering Control certification;
- b) to the best of my knowledge and belief, the work and conclusions described in this certification are in accordance with the requirements of the site remedial program, and generally accepted engineering practices; and the information presented is accurate and complete.

YES NO

☒ ☐

2. For each Engineering control listed in Box 4, I certify by checking "YES" below that all of the following statements are true:

- (a) The Engineering Control(s) employed at this site is unchanged since the date that the Control was put in-place, or was last approved by the Department;
- (b) nothing has occurred that would impair the ability of such Control, to protect public health and the environment;
- (c) access to the site will continue to be provided to the Department, to evaluate the remedy, including access to evaluate the continued maintenance of this Control;
- (d) nothing has occurred that would constitute a violation or failure to comply with the Site Management Plan for this Control; and
- (e) if a financial assurance mechanism is required by the oversight document for the site, the mechanism remains valid and sufficient for its intended purpose established in the document.

YES NO

☒ ☐

**IF THE ANSWER TO QUESTION 2 IS NO, sign and date below and
DO NOT COMPLETE THE REST OF THIS FORM. Otherwise continue.**

A Corrective Measures Work Plan must be submitted along with this form to address these issues.

Signature of Owner, Remedial Party or Designated Representative

Date

IC CERTIFICATIONS
SITE NO. 961009

Box 6

SITE OWNER OR DESIGNATED REPRESENTATIVE SIGNATURE

I certify that all information and statements in Boxes 1, 2, and 3 are true. I understand that a false statement made herein is punishable as a Class "A" misdemeanor, pursuant to Section 210.45 of the Penal Law.

I John Pekala at Motorola Solutions, Inc.
3332 E. Broadway Rd., Phoenix, AZ 85040
print name print business address

am certifying as Remedial Party (Owner or Remedial Party)

for the Site named in the Site Details Section of this form.


Signature of Owner, Remedial Party, or Designated Representative
Rendering Certification

8/8/2023
Date

EC CERTIFICATIONS

Box 7

Qualified Environmental Professional Signature

I certify that all information in Boxes 4 and 5 are true. I understand that a false statement made herein is punishable as a Class "A" misdemeanor, pursuant to Section 210.45 of the Penal Law.

I PATRICK ALLENSTEIN at KPRG AND ASSOCIATES, INC.
print name 14665 W LISBON RD, STE 1A, BROOKFIELD, WI 53005
print business address

am certifying as a Qualified Environmental Professional for the MOTOROLA SOLUTIONS, INC.
(Owner or Remedial Party)


Signature of Qualified Environmental Professional, for
the Owner or Remedial Party, Rendering Certification

Stamp
(Required for PE)

8-9-23
Date

ATTACHMENT 6

**Cemetery Creek, Soil Cover, Drainage Swale,
and Sub-Slab Depressurization System Inspection Reports**

Cemetery Creek Inspection Form

Inspector:

Name

Date

Jim Bodurkin
December 19, 2022

Type of Inspection:

quarterly

semi-annual

annual

severe weather

Item	Observation			Comments
1. Qualitative Stream Flow Estimate	Trickle 3/4 channel	1/4 channel full channel (highlight one)	<u>1/2 channel</u> flood	
2. Condition of Channel Banks (Evidence of erosion)	<u>Good</u>	Fair (highlight one)	Poor	
3. Debris/Flow Blockage (any debris or fallen trees, etc.)	Present (highlight one)		<u>Not Present</u>	
4. Evidence of Scouring (Channel bottom erosion)	Yes (highlight one)		<u>No</u>	
5. Evidence of Sedimentation (Channel bottom filling)	Yes (highlight one)		<u>No</u>	

6. Additional Comments:

None

7. Items to be observed in future inspections:

None

8. Recommended maintenance activities:

None

Soil Erosion Prevention Site Inspection Form
(Waste Water Treatment Facility and Former Chemical Storage Building Area)

Inspector:

Name

Date

Jim Bradstreet
December 19, 2022

Type of Inspection:

quarterly

semi-annual

annual

severe weather

	Observation			Comments
	Good	Fair	Poor	
1. Vegetative cover (condition, trees or bushes on cap)	X			
2. Soil stability (erosion control)	X			
3. Cover integrity (no exposed stabilized soil or ruts)	X			
4. Surface water drainage (settlement or ponding)	X			
5. Unauthorized access control (fence, gates, locks, signs vandalism)	X			
6. Other activities on or adjacent to soil erosion prevention area	X			
7. Upgradient Storm Water Swale (condition, encroachment of brush, erosion, etc.)	X			

8. Additional Comments:

None

9. Items to be observed in future inspections:

None

10. Recommended maintenance activities:

None

Cemetery Creek Inspection Form

Inspector:

Name

Date

Jim Bedenstun
June 13, 2023

Type of Inspection:

quarterly

semi-annual

annual

severe weather

Item	Observation			Comments
1. Qualitative Stream Flow Estimate	Trickle 3/4 channel	<u>1/4 channel</u> full channel (highlight one)	1/2 channel flood	
2. Condition of Channel Banks (Evidence of erosion)	<u>Good</u>	Fair (highlight one)	Poor	
3. Debris/Flow Blockage (any debris or fallen trees, etc.)	Present (highlight one)		<u>Not Present</u>	
4. Evidence of Scouring (Channel bottom erosion)	Yes (highlight one)		<u>No</u>	
5. Evidence of Sedimentation (Channel bottom filling)	Yes (highlight one)		<u>No</u>	

6. Additional Comments:

None

7. Items to be observed in future inspections:

None

8. Recommended maintenance activities:

None

Soil Erosion Prevention Site Inspection Form
(Waste Water Treatment Facility and Former Chemical Storage Building Area)

Inspector:

Name

Date

Joe Robinson
June 13, 2023

Type of Inspection:

quarterly

semi-annual

annual

severe weather

	Observation			Comments
	Good	Fair	Poor	
1. Vegetative cover (condition, trees or bushes on cap)	X			
2. Soil stability (erosion control)	X			
3. Cover integrity (no exposed stabilized soil or ruts)	X			
4. Surface water drainage (settlement or ponding)	X			
5. Unauthorized access control (fence, gates, locks, signs vandalism)	X			
6. Other activities on or adjacent to soil erosion prevention area	X			
7. Upgradient Storm Water Swale (condition, encroachment of brush, erosion, etc.)	X			

8. Additional Comments:

None

9. Items to be observed in future inspections:

None

10. Recommended maintenance activities:

None

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 7/28/2022

Inspector CD (Doyle Environmental)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 8/17/22

Inspector CCD

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	
Subsystem #5	<u>Operating</u> Not operating	Good Poor	0.5	
Subsystem #6	Operating Not operating	Good Poor	0.6	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 9/8/2022

Inspector CCD (Doeg Environ)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 10/10/22

Inspector CCD (Day Environmental)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 11 / 10 / 2022

Inspector CD

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 12/7/23 12/07/2022

Inspector Day Emilio

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.3	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.3	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 1/12/2023

Inspector Day Emmanuel (CA)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.3	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.3	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 2/2/2023

Inspector CCD

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 3 / 15 / 23

Inspector CCD Dany

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 4 / 5 / 2023

Inspector Jay Environmental / CCD

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.3	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.6	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____

Sub-slab Depressurization System Inspection Form

(Administrative Offices Wing of Plant)

Date 5/4/2023

Inspector Day Environmental (CD)

SSD Subsystem No.	Observation			Comments
	Vacuum Blower/ Fans (circle one)	Piping Condition	Manometer reading (inches water)	
Subsystem #1	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #2	<u>Operating</u> Not operating	<u>Good</u> Poor	0.4	
Subsystem #3	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #4	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #5	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	
Subsystem #6	<u>Operating</u> Not operating	<u>Good</u> Poor	0.5	

Additional Comments _____

Items to be observed in future inspections: _____

Recommended maintenance activities: _____



**CERTIFIED
RADON SYSTEMS**
lower levels. higher expectations.

MANOMETER READINGS

DATE: OCTOBER 13, 2022

MANOMETER LOCATION	MANOMETER READING ("WC)	CHANGE IN READING 10/30/20- 10/4/21 ("WC)
358 Main St, Arcade, NY 14009	1.4	+0.7
364 Main St, Arcade, NY 14009	2.0	+1.0
372 Main St, Arcade, NY 14009	UNKNOWN	UNKNOWN

These changes in manometer readings reflect a minimal change in the negative pressure of each system. This amount is most likely due to more or less water present underneath the slab. All systems are functioning as intended with sufficient air movement beneath the slab so as to be conducive of sufficient TCE remediation.



**CERTIFIED
RADON SYSTEMS**
lower levels. higher expectations.

BASE MANOMETER READINGS

DATE: OCTOBER 13, 2022

FOR:

400 Main St.
Arcade, NY 14009

MANOMETER LOCATION	MANOMETER READING ("WC)	CHANGE IN READING 10/4/21-10/13/22 ("WC)
1	0.6	0
2	0.4	-0.1
3	0.5	0
4	0.5	+0.1
5	0.3	+0.1
6	0.5	0

These changes in manometer readings reflect a minimal change in the negative pressure of each system. All systems are functioning as intended with sufficient air movement beneath the slab so as to be conducive of sufficient TCE remediation.



2

Prostate
Indication: Prostate
Facility
Use of Tobacco
Allowed in
Personal Vehicle
Only







