




NYS DEC--Region 1 Tank Removal Report Routine/Spill # 95-03609

Establishment	
Name	Reynolds Channel
Address	QUEBEC Rd.
(Nearest X St.)
Municipality	Island Park
Phone	
County	Nassau Suffolk

Representatives On Site	
Contractor	M. Ivo.
Foreman	Gordan
Owner / Rep. Of Establishment	
Name	N/A - UNKNOWN
Address	
Phone	
Center	

Tank #	1	2				
Removal Date/Time	10/13/98 1pm	10/14/98 1pm				
Tank Size	4K	4K				
Content	oil	oil				
Pump System	Sub/Suct	Sub/Suct	Sub/Suct	Sub/Suct	Sub/Suct	Sub/Suct
Type of Tank	(S) F S/F	(S) F S/F	S F S/F	S F S/F	S F S/F	S F S/F
Degree of Corrosion						
Pitting	Y	Y				
Stain	Y	Y				
# of Holes/Cracks	20+	15+				
Tank Test Failure ?	Yes (No)	Yes (No)	Yes / No	Yes / No	Yes / No	Yes / No
Contaminated Soil Found ?	(Yes) / No	(Yes) / No	Yes / No	Yes / No	Yes / No	Yes / No
Amount Removed	100 yds	3+				

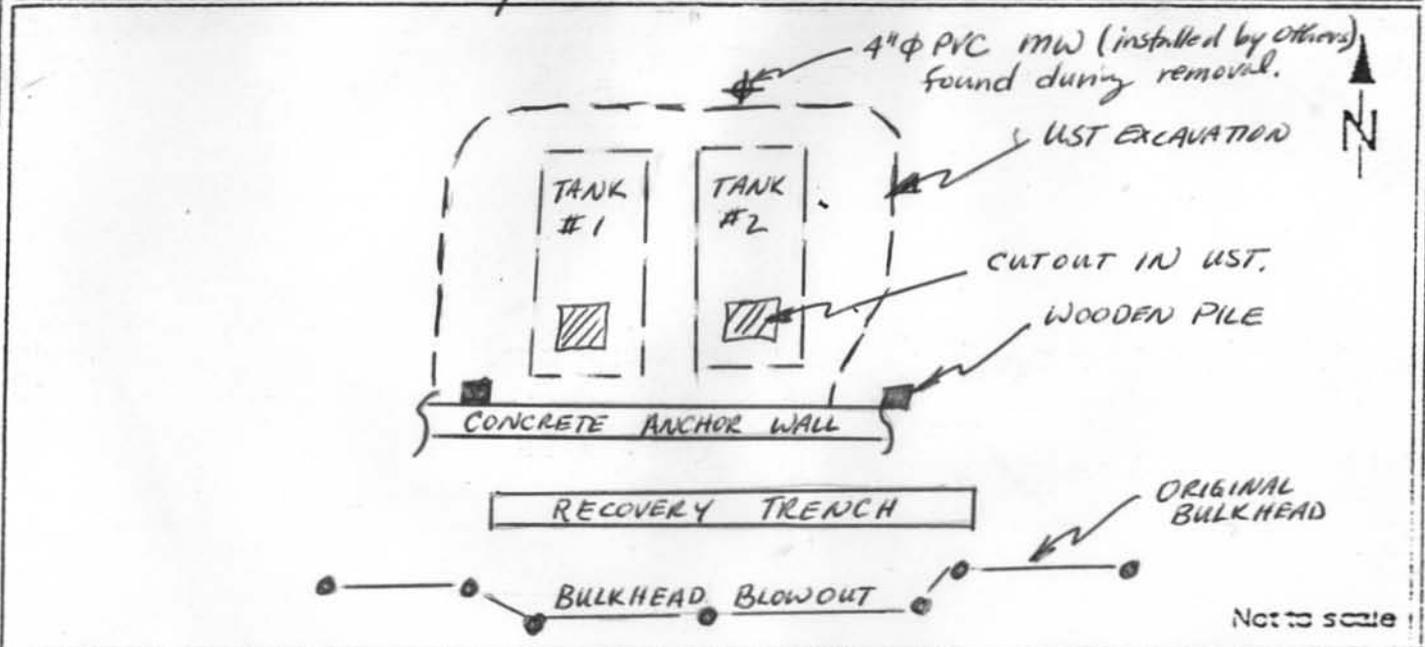

NYSDEC Removed USTS to stop bulkhead seepage
 USTS were installed half in G.W. and tanks covered with concrete to hold down. TANKS were 24ft long & 5'-3" in diameter. Floating product heavy on G.W. in excavation, oil coming to water surface during digging. Heavily stained soil at water table and below. M.Ivo. to keep vacuuming floating product. Excavation is tidally influenced. Contaminated soil stockpiled on site. Additional Actions needed. See photos

DEC INSPECTOR: Walter Parish

DATE: 10/16/98