

**PHASE I ENVIRONMENTAL
SITE ASSESSMENT REPORT**

**122 BRUCKNER DEVELOPMENT LLC
& 122 BRUCKNER PARTNERS LLC
517-519 EAST 132ND STREET
BRONX, NEW YORK 10454**

**TEAM ENVIRONMENTAL
CONSULTANTS, INC.
2 PETER BUSH DRIVE
MONROE, NEW YORK 10950
(845) 692-8124**

NOVEMBER 15, 2021

1.0 EXECUTIVE SUMMARY

Team Environmental Consultants, Inc. (TEAM), was authorized by 122 Bruckner Development LLC and 122 Bruckner Partners LLC, to conduct a Phase I Environmental Site Assessment (ESA) of a commercial property located at 517-519 East 132nd Street in the New York City Borough of Bronx, New York. TEAM's Phase I ESA was conducted in general conformance with ASTM Practice E 1527-13 (Standard Practice for Phase I ESA Process) guidelines. The objective of this effort was to identify significant environmental impairments and liabilities associated with the subject property. The requested scope of work included the following main tasks: 1) Review of readily available historical and regulatory information; 2) Performance of Phase I ESA interviews and a property walk-through inspection; 3) Review of a federal and state environmental database report; and 4) Documentation of findings in a Phase I ESA report.

Based on the property setting and current commercial site use, availability of a municipal water supply, review of available historical, regulatory, and environmental information, performance of Phase I ESA interviews, and findings of the property walk-through inspection, no significant and immediate environmental liability issues or "recognized environmental conditions" (RECs) associated with the subject property were identified.


2.0 PROPERTY DESCRIPTION

2.1 Site Description

The property is found along the northeastern side of East 132nd Street, approximately 500-feet southwest of the Major Deegan Expressway (Interstate Route 87), in the Borough of Bronx (Port Morris), Bronx County, City and State of New York (Figure 1). The site is situated within an urban setting and is bordered to the northwest by a commercial property (Amazon Fresh grocery pick-up location) and Brook Avenue, to the northeast by a Speedway gasoline station and Bruckner Boulevard, to the southeast by a multi-tenanted commercial structure (521-529 East 132nd Street), and to the southwest by East 132nd Street and supermarket (Food Fest Depot). The site topography is generally level and at grade with East 132nd Street. Photographs obtained during performance of the property walk-through inspection are presented within Attachment A.

The rectangular shaped 0.11-acre (50' x 100') property is improved with a partially occupied three-story (slab on grade) steel frame commercial structure. According to available online regulatory records and fire insurance maps, the building has an area of ~14,550-ft² (50' x 97') and was constructed circa-1900. A number of interior renovations have brought the structure to its present day configuration. The ground floor houses a motorcycle service and repair business

FIGURE 1 - SITE LOCATION MAP

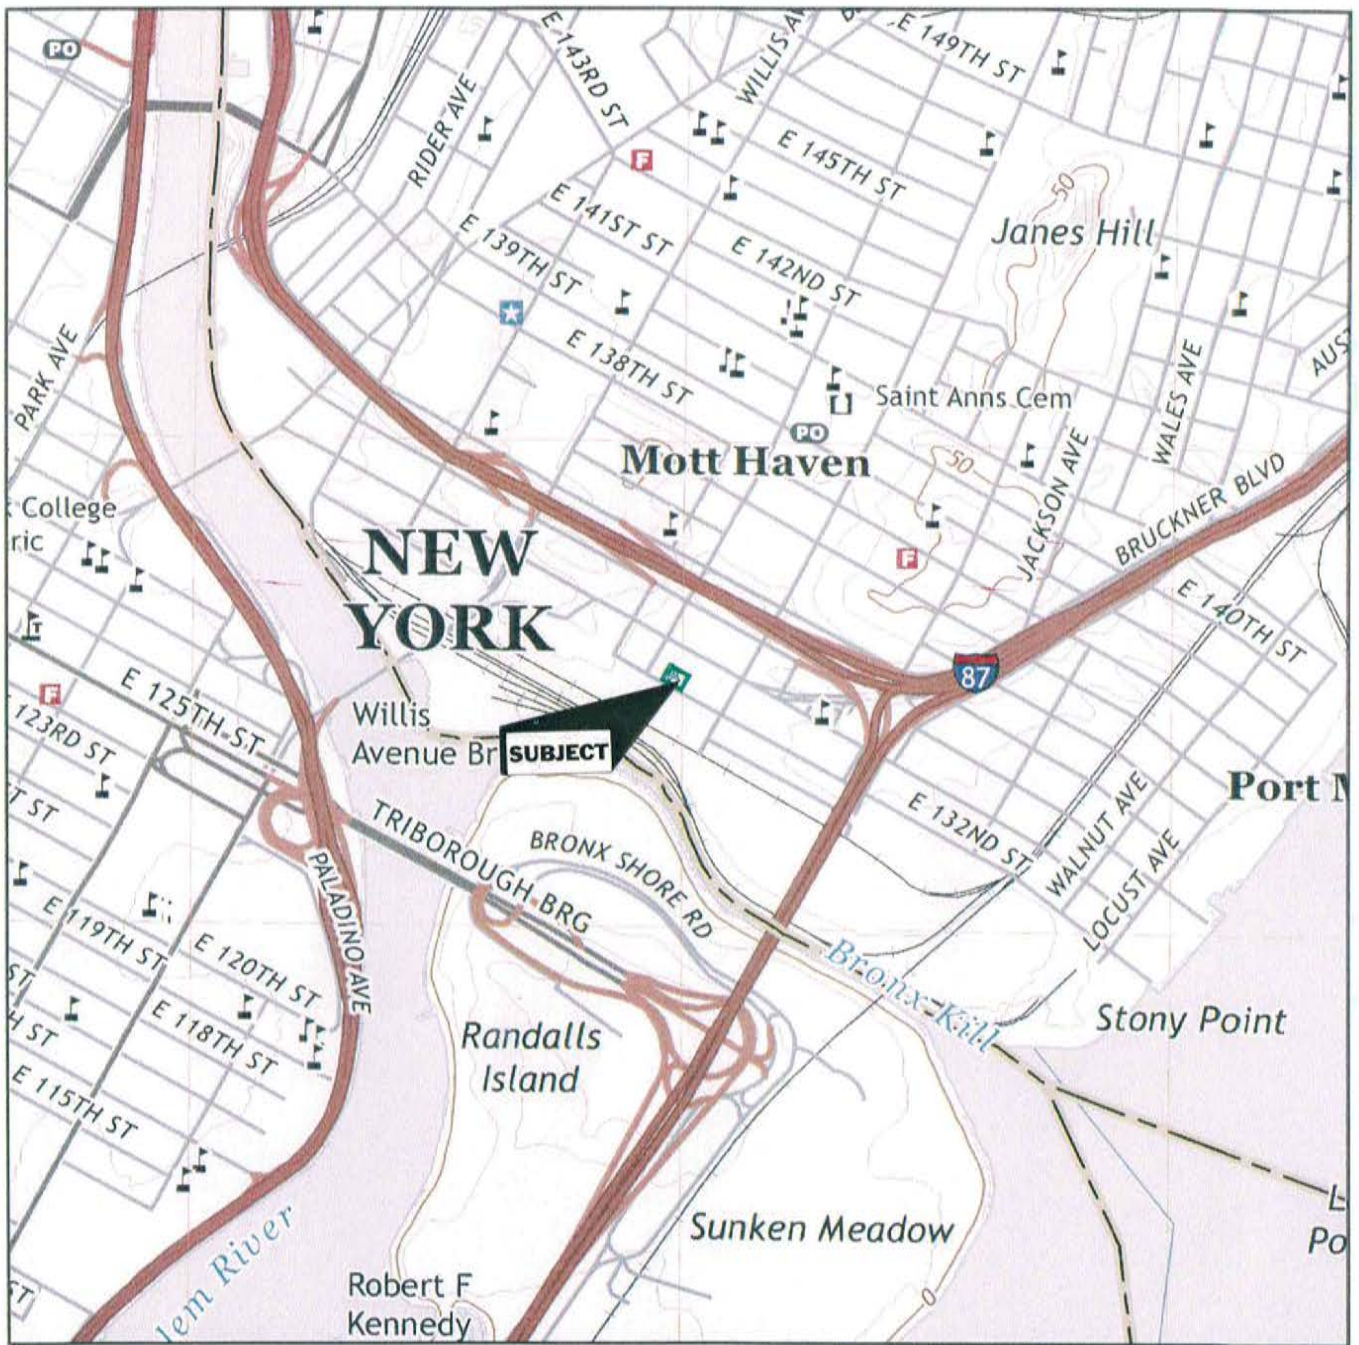

USGS TOPOGRAPHIC MAP
7.5 MINUTE SERIES - 2013
BRONX, NEW YORK

(Uptown Motors) and contains an office area, open repair shop, equipment and supply storage sections, motorcycle storage space, electrical meters and panels, and utility service connections. The unoccupied upper levels (accessed from an interior stairway and freight elevator) formerly contained warehouse space (second floor) and a privately operated radio station and offices (third floor). No onsite vehicle parking areas are provided. No documentation detailing historic site development or the performance of building renovation efforts was available for review. TEAM was informed that no major building renovation or site construction activities requiring the performance of soil excavation work are planned.

The site is located within City of New York zoning class R8A (Residential) district within a M1-2 (Manufacturing) overlay. The potable water supply and sanitary waste treatment service are provided by the City of New York (New York City Department of Environmental Protection). Facility heating and hot water service are supplied by natural gas fired equipment. No site or regulatory information concerning the onsite presence of any underground petroleum storage tanks (USTs) was available. Electrical service and natural gas are provided to the area by Consolidated Edison Utilities (ConEd). Non-hazardous solid waste is removed for offsite disposal by a private hauler. Utility service connections are located underground.

2.2 Site History

An on-line New York City Department of Finance Database indicated the subject property (City of New York Block 2260, Lot 38) to have been acquired by 122 Bruckner Development LLC and 122 Bruckner Partners LLC in December of 2012. Former property owners have reportedly included 220 East Realty, Inc. (1999-2012), Gassman Holding Corp.(1988-1999), Gassman Coal and Oil Co., Inc. (1981-1988), The Nestle Company, Inc. (?-1981), Berkshire Bottling Company (?-1970), and Rolling Spring Holding Corporation (?-1970). No previously conducted title searches, documentation detailing historic site ownership, or contact information for former property owners was available. None of the owners on record appear to have been an industrial concern that would be expected to have utilized the property for the manufacturing, storage, or disposal of hazardous materials or regulated waste products.

An 1891 Sanborn Fire Insurance Map identified the 517-519 East 132nd Street property to have been undeveloped. The present day three-story structure was illustrated on a 1908 map to be used for the "Storage of Piano Plates." The ground floor was indicated to contain a "Stable." The subject and adjoining property found to the southeast (521-529 East 132nd Street) were shown to be operated by "Crystal Spring Water Co." on the 1935-1986 maps. The subject three-story building was noted to be used for "Storage & Offices." The 1989-2007 figures identified the two properties to be tenanted by "Gassman Coal & Oil Co." with the subject structure being utilized for

"Storage & Offices." No Certificates of Occupancy were listed on an on-line City of New York Building Department web site. According to Phase I ESA interviews, Uptown Motors has operated onsite for ~five-years. Prior to this date, the ground floor reportedly contained a woodworking business. As noted, the upper two floors previously housed warehouse space (second floor) and a privately operated radio station and offices (third floor). Property owner representative, Matt Grabina (Altmark Group LLC), was unaware of any issues of environmental concern associated with the property. No site or regulatory information as to historic site use for industrial or manufacturing purposes (i.e., activities that would be expected to have routinely produced regulated hazardous materials or waste products) was available during performance of the Phase I ESA.

2.3 User Provided Information

No previously prepared title records, Phase I or II Environmental Site Assessment (ESA) reports, information concerning environmental liens, property use limitations, valuation reduction based on environmental issues, or commonly known/reasonably ascertainable information that is material to current recognized environmental conditions (RECs) in connection with the 517-519 East 132nd Street property location was provided to TEAM.

2.4 Aerial Photograph Review

Aerial photographs of the subject property vicinity were reviewed by TEAM to assist with the evaluation of historic site use. Photographs from 1954, 1966, 1974, 1980, and 1984 were inspected on an on-line National Environmental Title Research (NETR) website. Photographs were also obtained from a Google Earth website (March 1995, November 2002, October 2004, March 2008, June 2010, April 2016, and August 2020). The review of the older figures was difficult due to poor image quality. The present day three-story structure was shown on all aerials. Neighboring parcels appeared to be used for commercial purposes. The poor scale and clarity of inspected aerial photographs precluded an in-depth inspection of the target property for visual evidence of environmental impairment (e.g., aboveground storage tanks or illegal dumping). Copies of the 1995-2020 photographs are found in Attachment B.

2.5 Sanborn Fire Insurance Map Review

Sanborn Fire Insurance Maps were obtained for the East 132nd Street property location for the years 1891, 1908, 1935, 1944, 1946, 1947, 1951, 1968, 1969, 1977, 1978, 1980, 1981, 1984, 1986, 1989, 1991, 1992, 1993, 1994, 1995, 1996, 1998, 2001, 2002, 2003, 2004, 2005, 2006, and 2007. The review of several maps (copies found within Attachment C) was difficult due to poor clarity. The target property was noted to be undeveloped on the 1891 figure. The current

three-story building was shown on the 1908 map to be used for the "Storage of Piano Plates." The first floor was indicated to contain a "Stable." The subject and adjoining property to the southeast (521-529 East 132nd Street) were indicated to be operated by "Crystal Spring Water Co." on the 1935-1986 maps. The subject three-story building was depicted to have been used for "Storage & Offices." The 1989-2007 maps identified the two properties to be tenanted by "Gassman Coal & Oil Co." with the subject structure utilized for "Storage & Offices." None of the maps illustrated historic site use for industrial or manufacturing purposes (i.e., operations that would be expected to have routinely used or produced regulated hazardous materials and waste products) or the onsite presence of any underground petroleum (i.e., gasoline) storage tanks. Adjoining properties appeared to have been used for commercial and manufacturing purposes.

3.0 SITE INSPECTION

On October 29, 2021, TEAM together with Matt Grabina conducted an inspection of accessible sections of the building and surrounding property. The authorized scope of work did not include performance of any field sampling activities (e.g., asbestos, soil, mold, lead-based paint, or groundwater) or completion of a formal regulatory compliance audit, as it would relate to the use, storage, permitting, or disposal of regulated materials and waste products. A listing of Phase I ESA interview and information sources is presented as Attachment D.

3.1 Property Inspection

The inspection of accessible exterior property areas revealed no unusual odors or visual evidence of significant surface stains that could be indicative of leaking petroleum storage tanks, chemical spills, or industrial waste disposal. No PCB-labeled electrical equipment, aboveground petroleum or chemical storage tanks, suspected underground petroleum storage tank fill ports or vent pipes, unmarked waste storage containers, potable water supply wells or groundwater monitoring wells, or industrial waste storage or disposal facilities within the property confines were observed. No surface water bodies or freshwater wetland habitat areas were observed within or adjacent to the property. This was confirmed during the review of a USGS topographic map. The nearest surface water body (Bronx Kill) is situated approximately 550-feet to the southwest. The scope of work did not include the performance of formal wetland or flood plain delineation surveys.

3.2 Building Inspection

The inspection of accessible building sections (limited due to ongoing business activities and the presence parked motorcycles, maintenance equipment and supplies, and stored materials) revealed no unusual odors or visual evidence of PCB-labeled electrical equipment, unmarked waste storage drums, chemical spillage or surface stains, exposed mold, significant peeling or

chipping painted surfaces, or industrial waste storage areas. No exposed suspected friable asbestos containing materials (ACM) were observed. No information concerning the performance of asbestos inspection or abatement operations associated with historic building renovation efforts was available. The scope of work did not include the performance of asbestos or lead-based paint inspection or sampling surveys.

Identified within the Uptown Motors motorcycle service area were containerized lubrication and servicing fluids (e.g., oils, lubricants, degreasers, antifreeze), aboveground 275-gallon waste oil storage tank (AST), servicing equipment, and assorted tools and supplies. No unusual odors or visual evidence of gross product spillage were noted in the immediate vicinity of inspected containers or the waste oil AST. Generated waste fluids are removed for offsite disposal by a licensed hauler. No autobody repair or vehicle painting activities are performed onsite. No inground lift or floor drainage systems were noted in the service area. TEAM was informed that no hazardous waste products requiring RCRA manifesting and tracking procedures are generated as a result of current commercial site use or routine building maintenance activities. Generally good housekeeping practices were observed within inspected building areas.

4.0 RECORDS REVIEW AND DOCUMENTATION

4.1 Regulatory Review - NYSDEC/City of New York

The requested Phase I ESA time frame precluded submittal of Freedom of Information Legislation (FOIL) requests to the New York State Department of Environmental Conservation (NYSDEC) Region 2 Petroleum Bulk Storage Program, New York City Department of Environmental Protection (NYCDEP), or City of New York Bureau of Fire Prevention. As the 517-519 East 132nd Street property location was not identified within the NYSDEC PBS (Petroleum Bulk Storage), CBS (Chemical Bulk Storage), LUST (Leaking Underground Storage Tanks), RCRIS (Hazardous Waste Generator), or SPILLS Databases (Section 4.2), these regulatory agencies would not appear to maintain file documentation pertaining to issues of environmental concern.

4.2 Federal and State Environmental Database Report

TEAM has obtained an Environmental Data Resources (EDR) Site Assessment Report, which provides information concerning the target property and those sites listed within any of the following Federal and State environmental databases:

- National Priority List (NPL);
- Resource Conservation and Recovery Information System (RCRIS),
Large Quantity Generators and TSD Facilities,

Small Quantity Generators and Transporters;

- New York State/Tribal Brownfield Sites (BROWNFIELD);
- New York State Spills Database (SPILLS);
- Comprehensive Environmental Response, Compensation, and Liability System (CERCLIS);
- CERCLIS “No Further Remedial Action Planned” Sites (NFRAP);
- New York State Registry of Inactive Hazardous Waste Disposal Sites (SHWS);
- Facility Index System (FINDS);
- Air Facility System (US AIRS);
- Integrated Compliance Information System (ICIS);
- Hazardous Materials Incident Report System (HMIRS);
- Toxic Substances Control Act Tracking System (FTTS);
- Environmental Restoration Program (ERP);
- State Pollutant Discharge Elimination (SPDES);
- Registered Dry Cleaners (DRYCLEANERS);
- Hazardous Waste Manifest Data (MANIFEST);
- Major Oil Storage Facility (MOSF);
- Emergency Response Notification System (ERNS);
- New York Leaking Storage Tanks (LUST);
- New York State DEC Voluntary Cleanup Program (VCP);
- New York Active Solid Waste Facility Register (SWL); and
- New York Registered Bulk Storage Tanks (UST/AST).

The EDR Database Report presented in Attachment E, identified no NPL, CERCLIS, NFRAP, ERNS, SHWS, DRYCLEANERS, MOSF, HMIRS, or ERP sites within the survey radius. Two SWL, three VCP, three BROWNFIELD, nine LUST, and eighty-four SPILLS sites are located within a one-eighth to one-quarter mile distance. The nearest of these is a SPILLS and LUST site (former Hess and current Speedway gasoline station property) found to the northeast at 126 Bruckner Boulevard. Spill Dates were indicated as January 22, 1987 (750-gallon gasoline release caused by human error - NYSDEC Spill No. 86-06553), July 30, 1992 (Hess Station No. 32506 - “contaminated soil discovered during tank pull” - NYSDEC Spill No. 92-05097), July 12, 1994 (Hess Station No. 32506 - contaminated soil found during the performance of tank removal activities - NYSDEC Spill No. 94-05017), and June 17, 2019 (Speedway Store No. 7811 - seven gallon gasoline release from hole in hose associated with product dispenser - NYSDEC Spill No. 19-02733). The remedial status for all four spill events was reported to be “closed.” The closest BROWNFIELD site is situated to the east at 138 Bruckner Boulevard. No significant offsite environmental issues or regulatory concerns were referenced in the database description. The nearest VCP and SWL sites are located over 300-feet from the target property.

The 517-519 East 132nd Street property address was identified in the UST (220 East Realty LLC), FINDS (Sparkz Iron Works Corp. and Bright Light Construction) and ICIS (Bright Light Construction) Databases. According to Phase I ESA interviews, these listings are associated with neighboring properties found to the northwest and southeast which were formerly operated by a common entity. No issues of current environmental or regulatory concern were noted in the database listings. As the subject property is serviced with a municipal water supply, the proximity of EDR identified sites would not appear to impact or pose significant environmental liabilities with respect to current site use or water quality issues.

5.0 CONCLUSIONS

Based on the property setting and current commercial site use, availability of a municipal water supply, review of available historical, regulatory, and environmental information, performance of Phase I ESA interviews, and findings of the property walk-through inspection, no significant and immediate environmental liability issues or “recognized environmental conditions” (RECs) associated with the 517-519 East 132nd Street property location were identified. No follow-up environmental site investigations are recommended.

6.0 LIMITATIONS & RELIANCE

The conclusions stated are based on the limits of the investigation described herein. TEAM can offer no assurances and assumes no responsibility for site conditions or activities which were outside the scope of the inquiry requested. It should be understood that TEAM has relied on the accuracy of documents, oral information, and other material and information provided by sources documented in this report. There can be no assurance, and TEAM offers no assurance, that site conditions do not exist or could not exist in the future which were undetected and which could lead to liability in connection with the site. Similarly, past and present activities on the site indicating potential environmental concerns may not have been discovered by TEAM's inquiries. TEAM was not requested to perform any follow-up environmental field investigations pertaining to site observations and documented historic property use. I (Martin C. Wodka) declare that to the best of my professional knowledge and belief, I meet the definition of Environmental Professional as defined in §312.10 of this part (40 CFR Part 312). I have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the property. The Phase I ESA report was prepared for reliance by Lakeland Bank, Altmark Group LLC, 122 Bruckner Development LLC, and 122 Bruckner Partners LLC.



Martin C. Wodka
President

ATTACHMENT A

SITE PHOTOLOG

ATTACHMENT A – PHOTOLOG

122 BRUCKNER DEVELOPMENT & PARTNERS LLC

517-519 EAST 132ND STREET, BRONX, NEW YORK

<u>Photo No.</u>	<u>Description</u>
1	Eastern view from East 132nd Street towards subject three-story commercial structure.
2	Northeastern view from East 132nd Street.
3	Northwestern view from East 132nd Street.
4	View towards ground floor lease space tenanted by Uptown Motors.
5	Entrance to Uptown Motors lease space.
6	Uptown Motors office area.
7	Motorcycle service area.
8	Motorcycle service area.
9	Drums containing virgin lubrication and servicing fluids.
10	Waste oil storage tank.
11	Natural gas fired heating unit.
12	Electrical meters and panels found on ground floor level.
13	Interior view within unoccupied second floor level.
14	Interior view within unoccupied second floor level.
15	Ceiling mounted heating unit located on second floor.
16	Former second floor kitchen area.
17	Third floor hallway.
18	Former third floor radio station office.
19	Former third floor office space.
20	Former third floor office space.



1



2



3



4



5



6




7



8



9

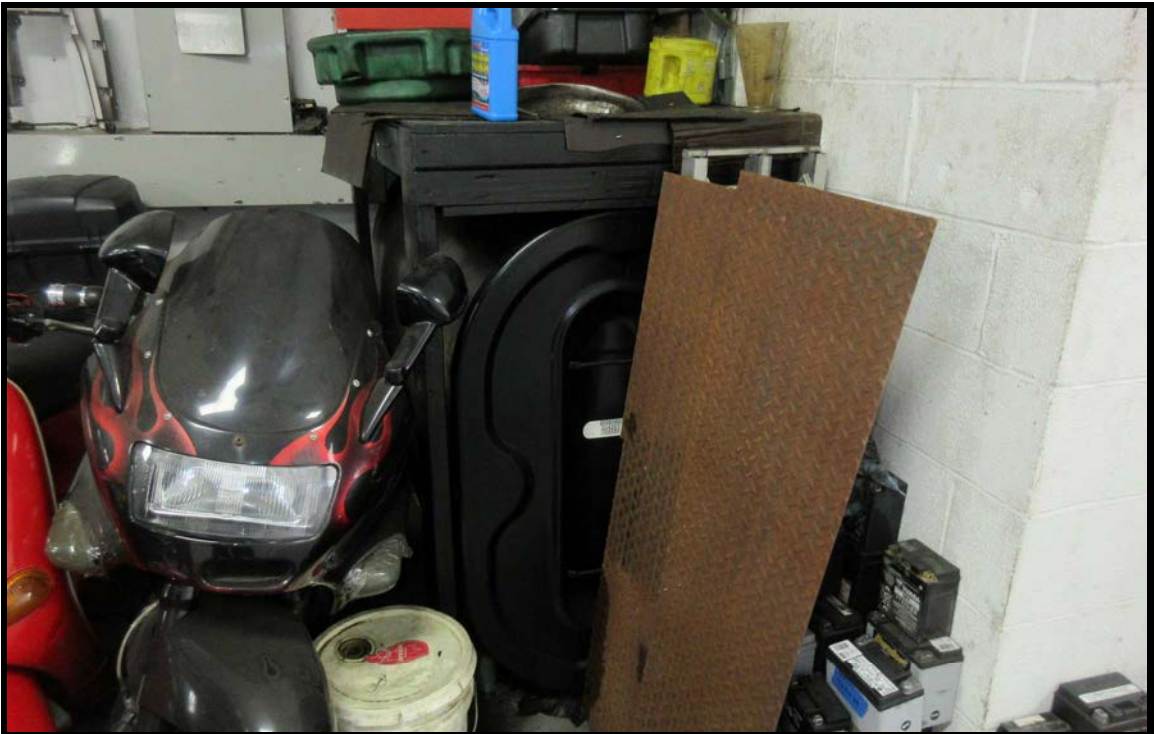

10



11



12



13



14




15



16



17

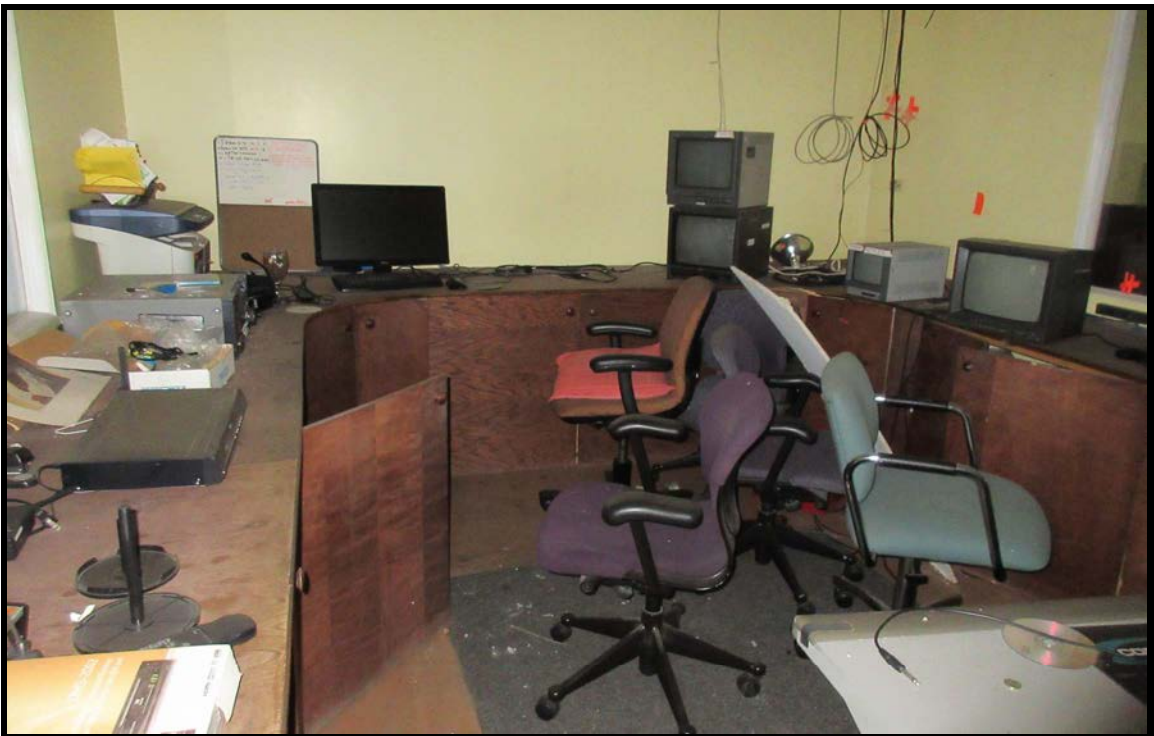

18



19



20

ATTACHMENT B

AERIAL PHOTOGRAPHS

AUGUST 2020

SUBJECT

Google Earth

80 ft



AUGUST 2020

Bronx Kill

Google Earth

400 ft



APRIL 2016

Google Earth



100 ft

JUNE 2010

Google Earth



100 ft

MARCH 2008

Google Earth

Image U.S. Geological Survey



100 ft

OCTOBER 2004



Google Earth

Image © 2021 Maxar Technologies



100 ft

NOVEMBER 2002

Google Earth

Image © 2021 Maxar Technologies



100 ft

MARCH 1995

Google Earth

Image U.S. Geological Survey



100 ft

ATTACHMENT C

SANBORN FIRE INSURANCE MAPS

517-521 East 132nd Street
517-521 East 132nd Street
Bronx, NY 10454

Inquiry Number: 6745885.5
November 11, 2021

Certified Sanborn® Map Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

11/11/21

Site Name:

517-521 East 132nd Street
517-521 East 132nd Street
Bronx, NY 10454
EDR Inquiry # 6745885.5

Client Name:

Team Environmental Consultants
2 Peter Bush Drive
Monroe, NY 10950
Contact: Martin Wodka



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by Team Environmental Consultants were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # A12F-4EA7-9B90

PO # NA

Project NA

Maps Provided:

2007	1996	1984	1947
2006	1995	1981	1946
2005	1994	1980	1944
2004	1993	1978	1935
2003	1992	1977	1928
2002	1991	1969	1908
2001	1989	1968	1903
1998	1986	1951	1891



Sanborn® Library search results

Certification #: A12F-4EA7-9B90

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ☒ Library of Congress
- ☒ University Publications of America
- ☒ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

Team Environmental Consultants (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.


Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice. Copyright 2021 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.







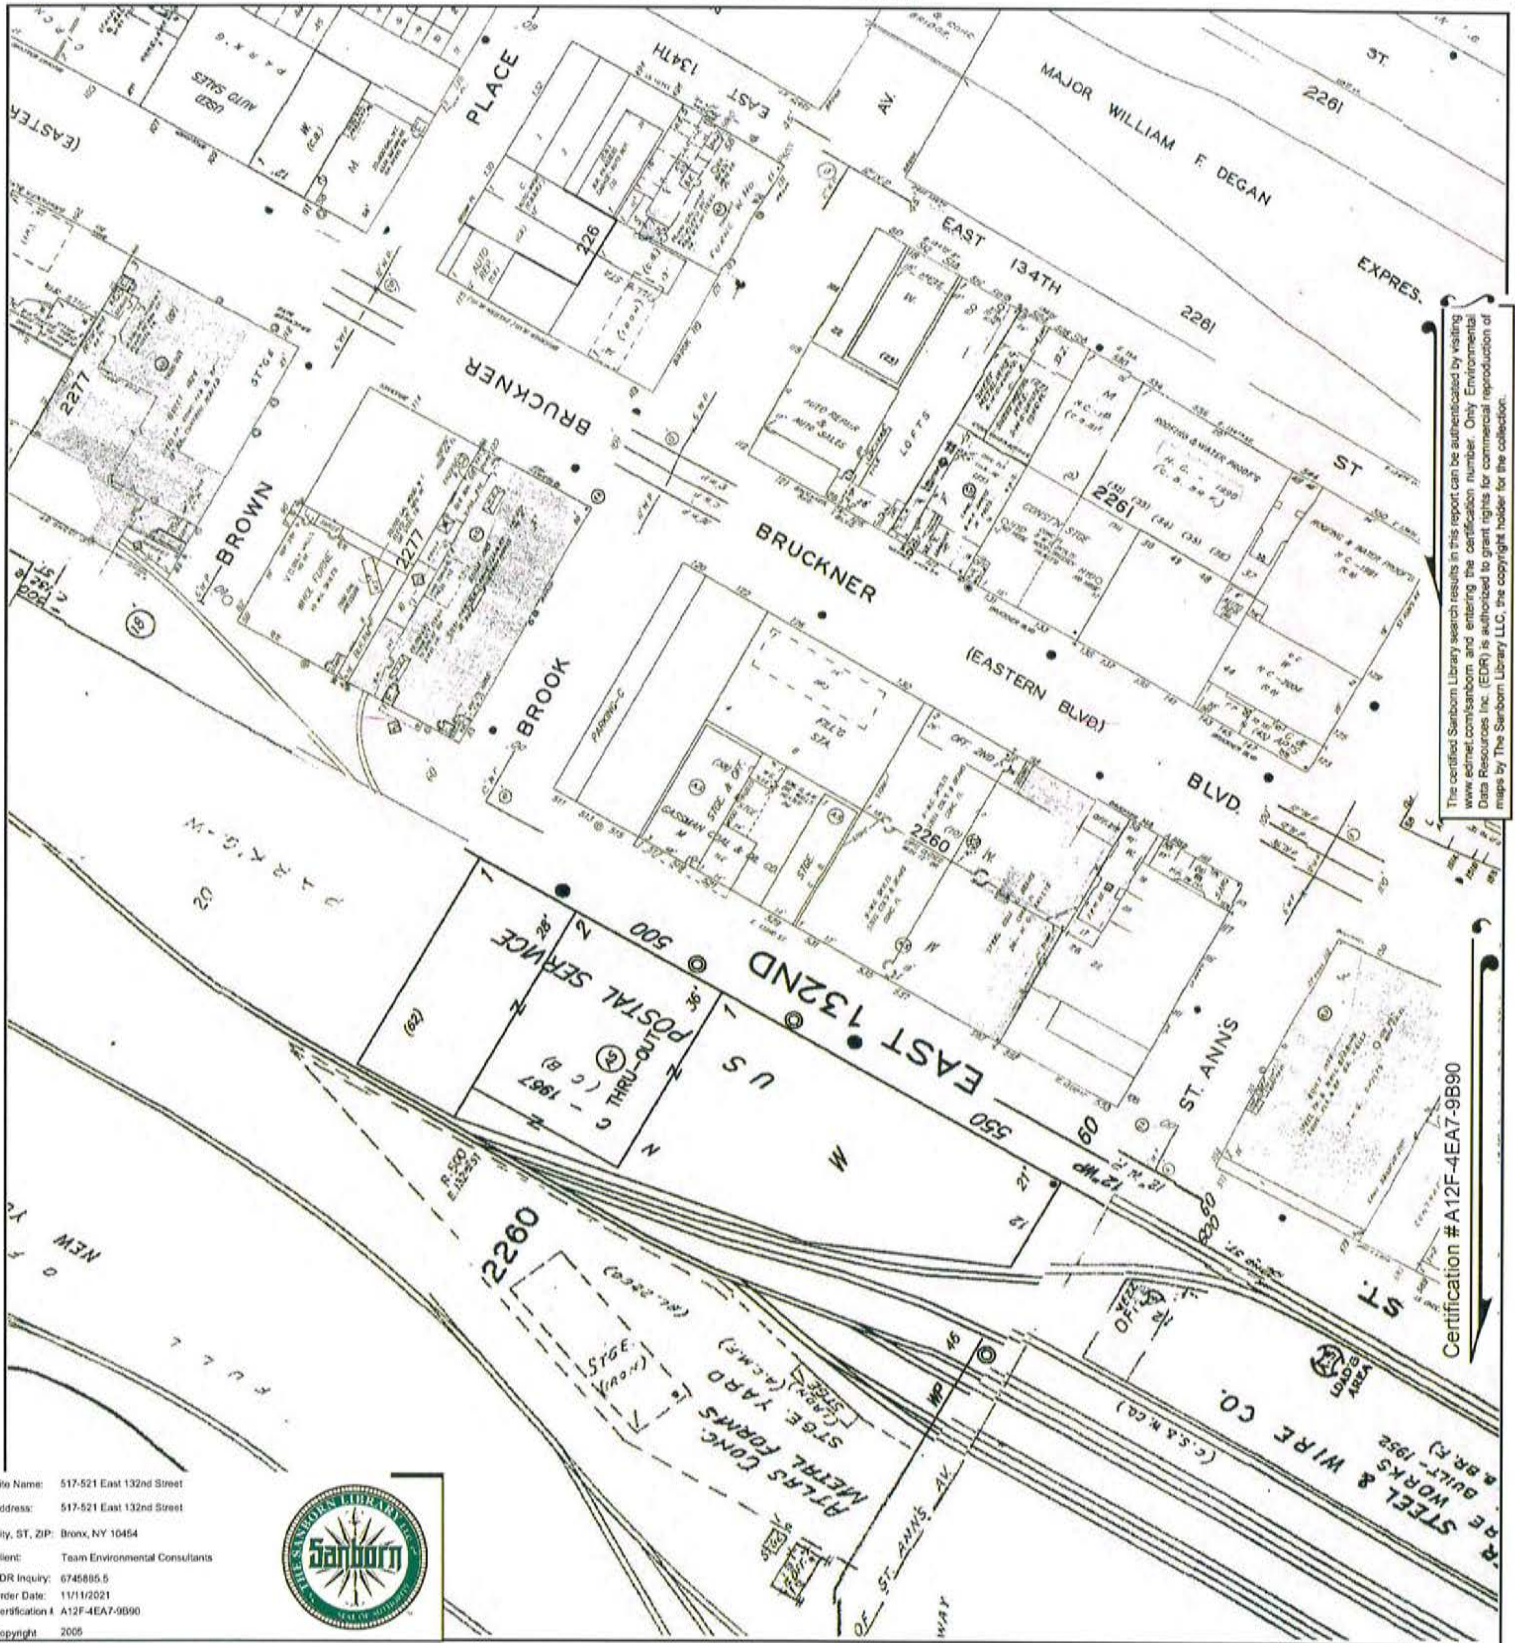

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification: A12F-4EA7-9B90
 Copyright: 2005




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

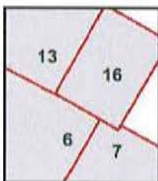

Volume 9S, Sheet 6
 Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 7

The certified Sanborn Library search results in this report can be authenticated by visiting
 www.edr.com/sanborn and entering the certification number. Only Environmental
 Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of
 maps by The Sanborn Library LLC, the copyright holder for the collection.


Certification #A12F-4EA7-9B90

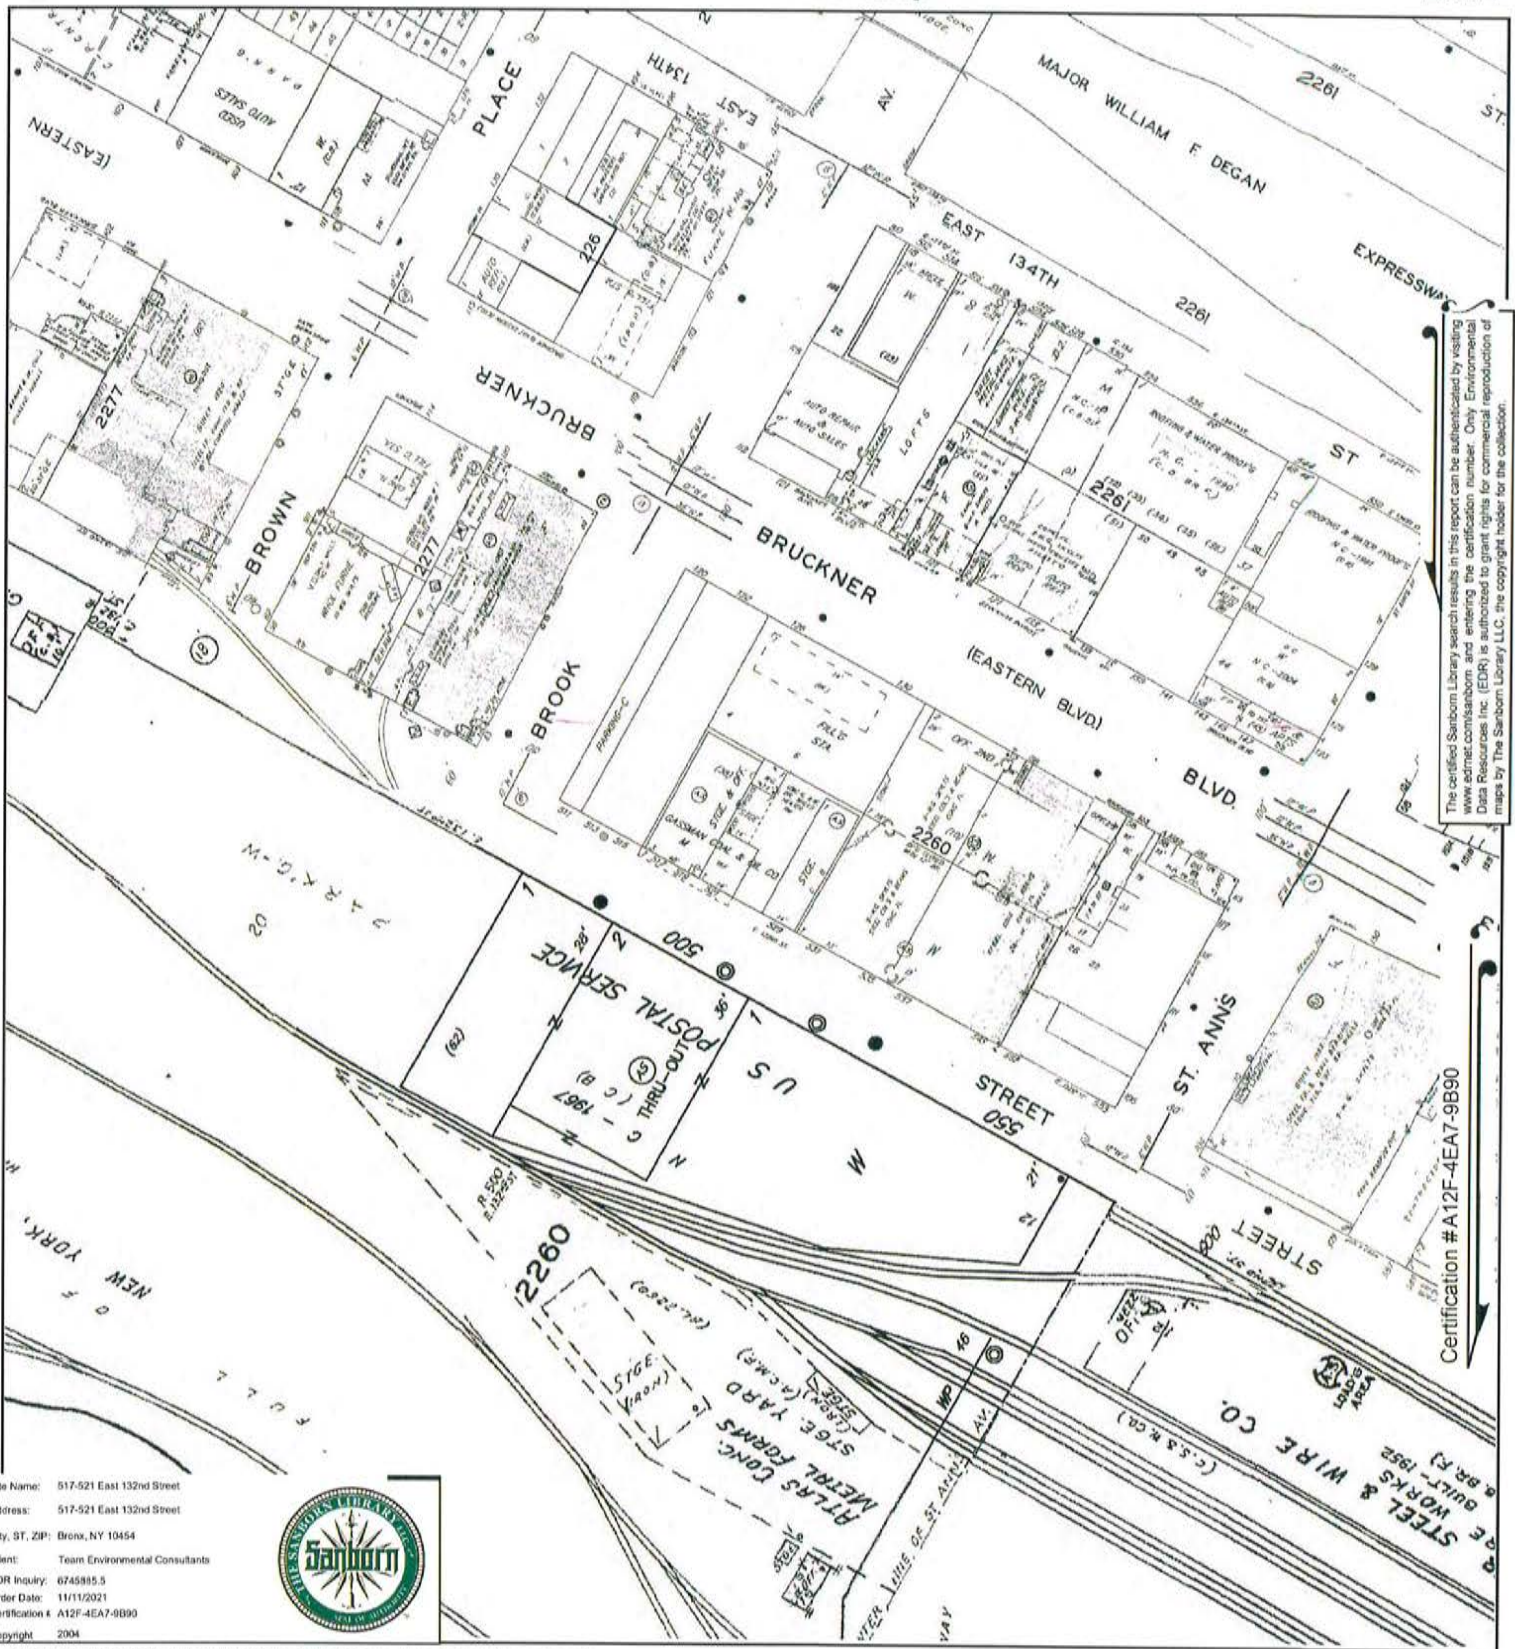


Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 2004



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.





Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6

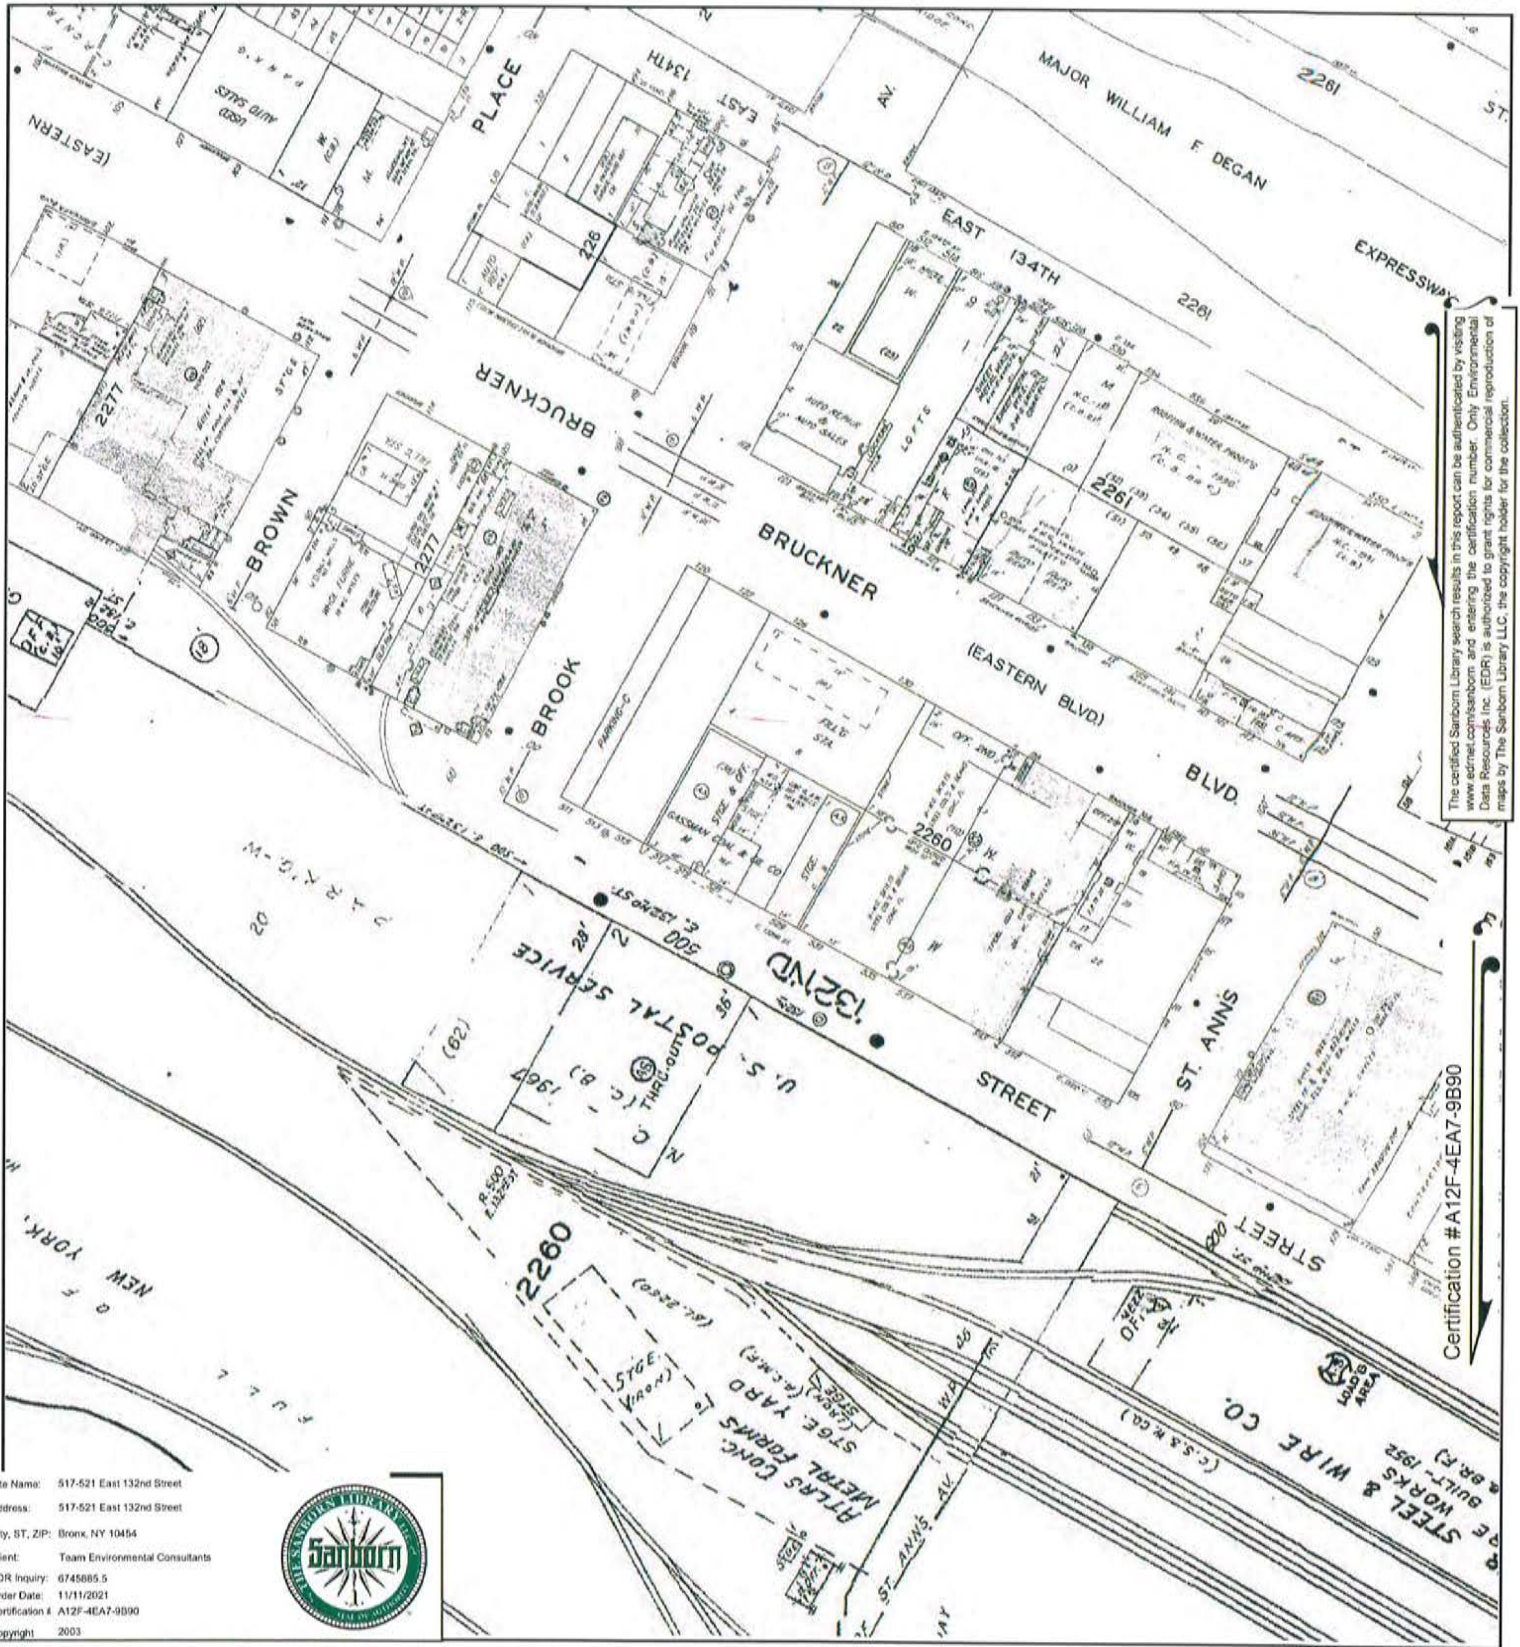


Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 2003




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

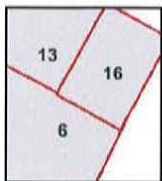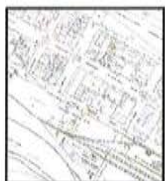

Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 6




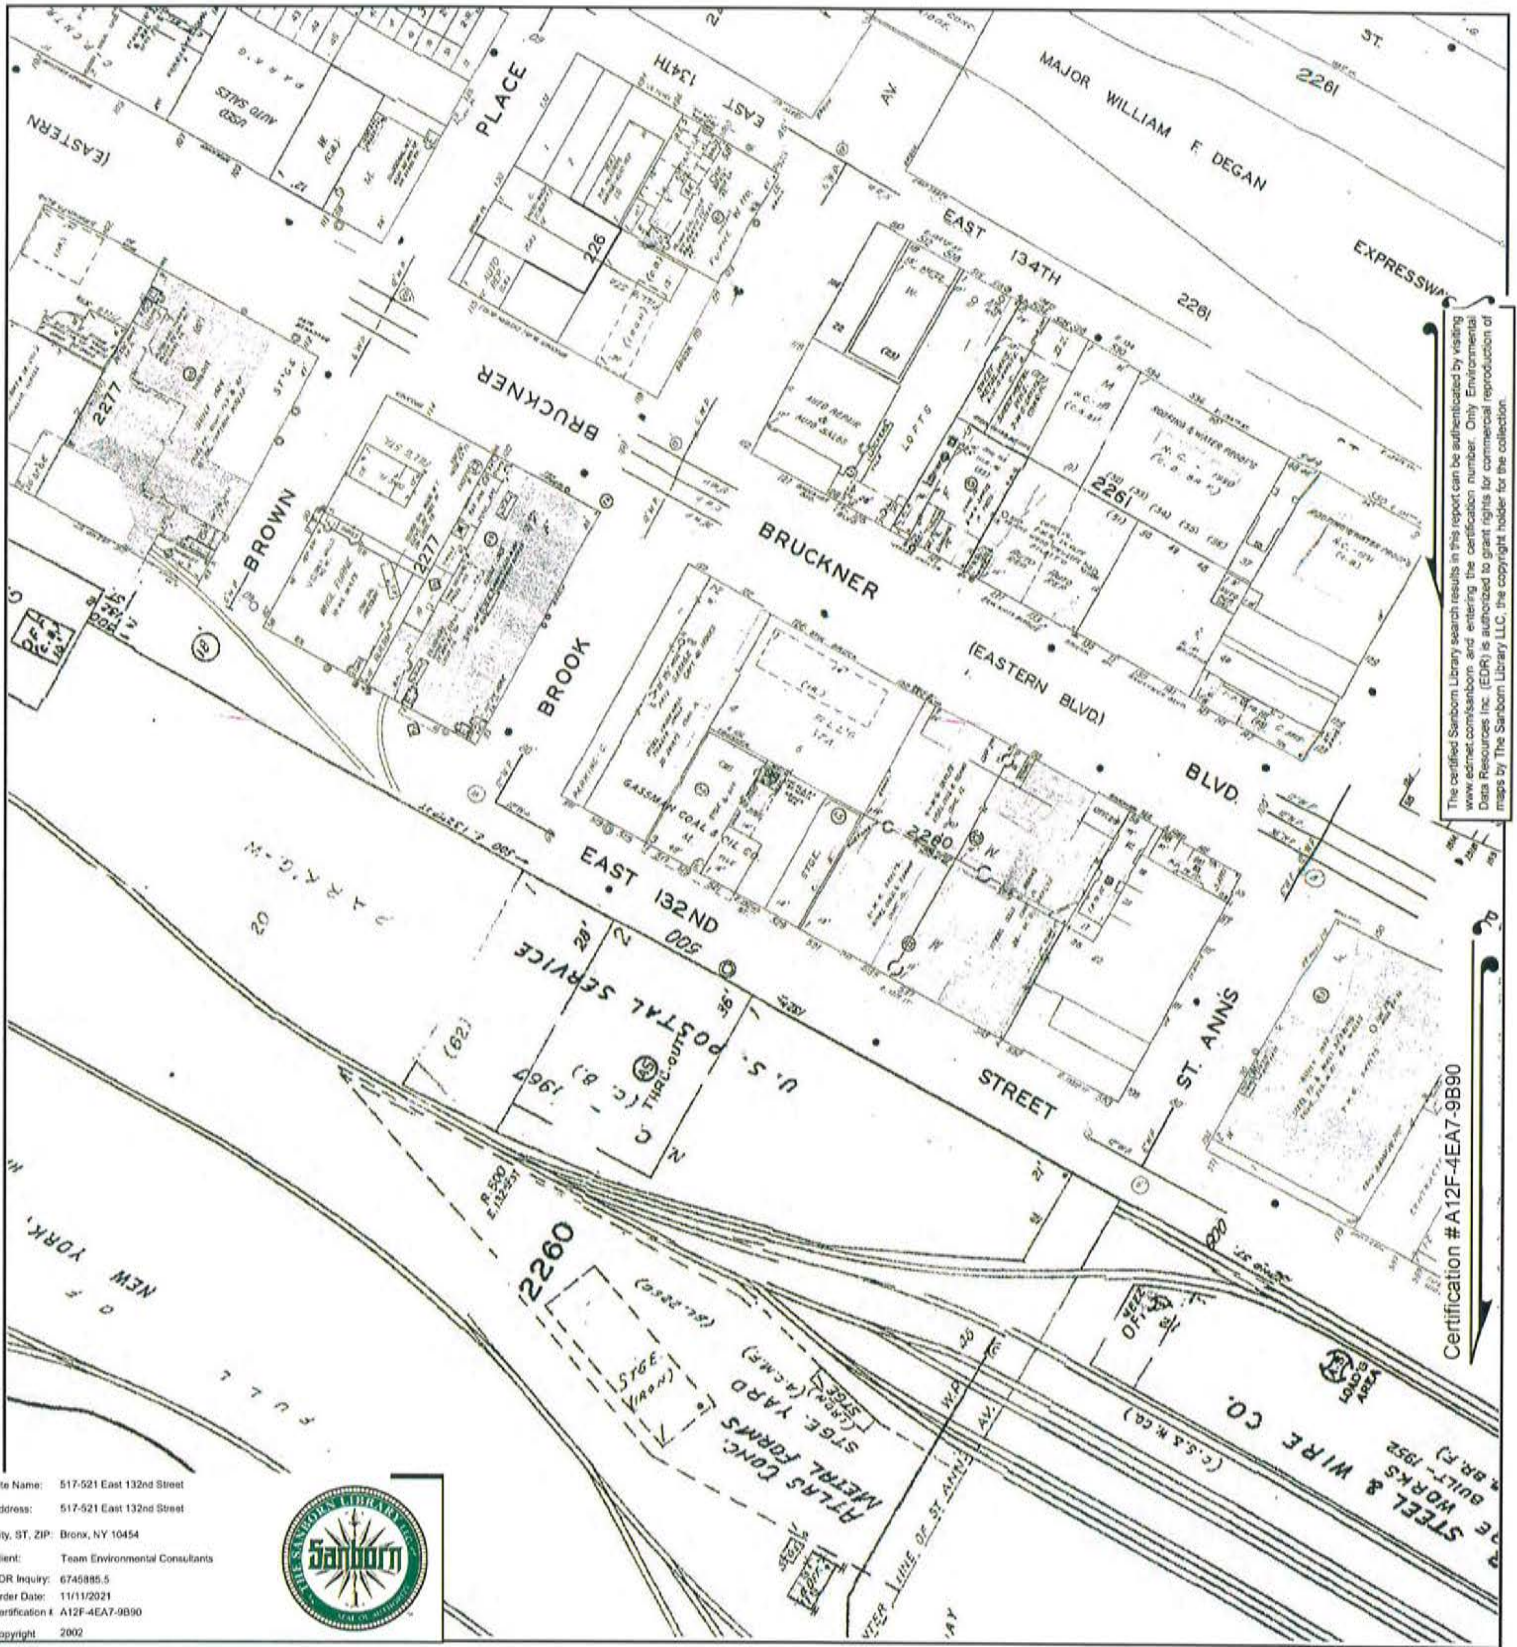

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 2002



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

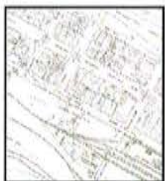


Volume 9S, Sheet 7
 Volume 9S, Sheet 6
 Volume 9S, Sheet 16
 Volume 9S, Sheet 13

0 Feet 150 300 600



The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.


Certification #A12F-4EA7-9B90

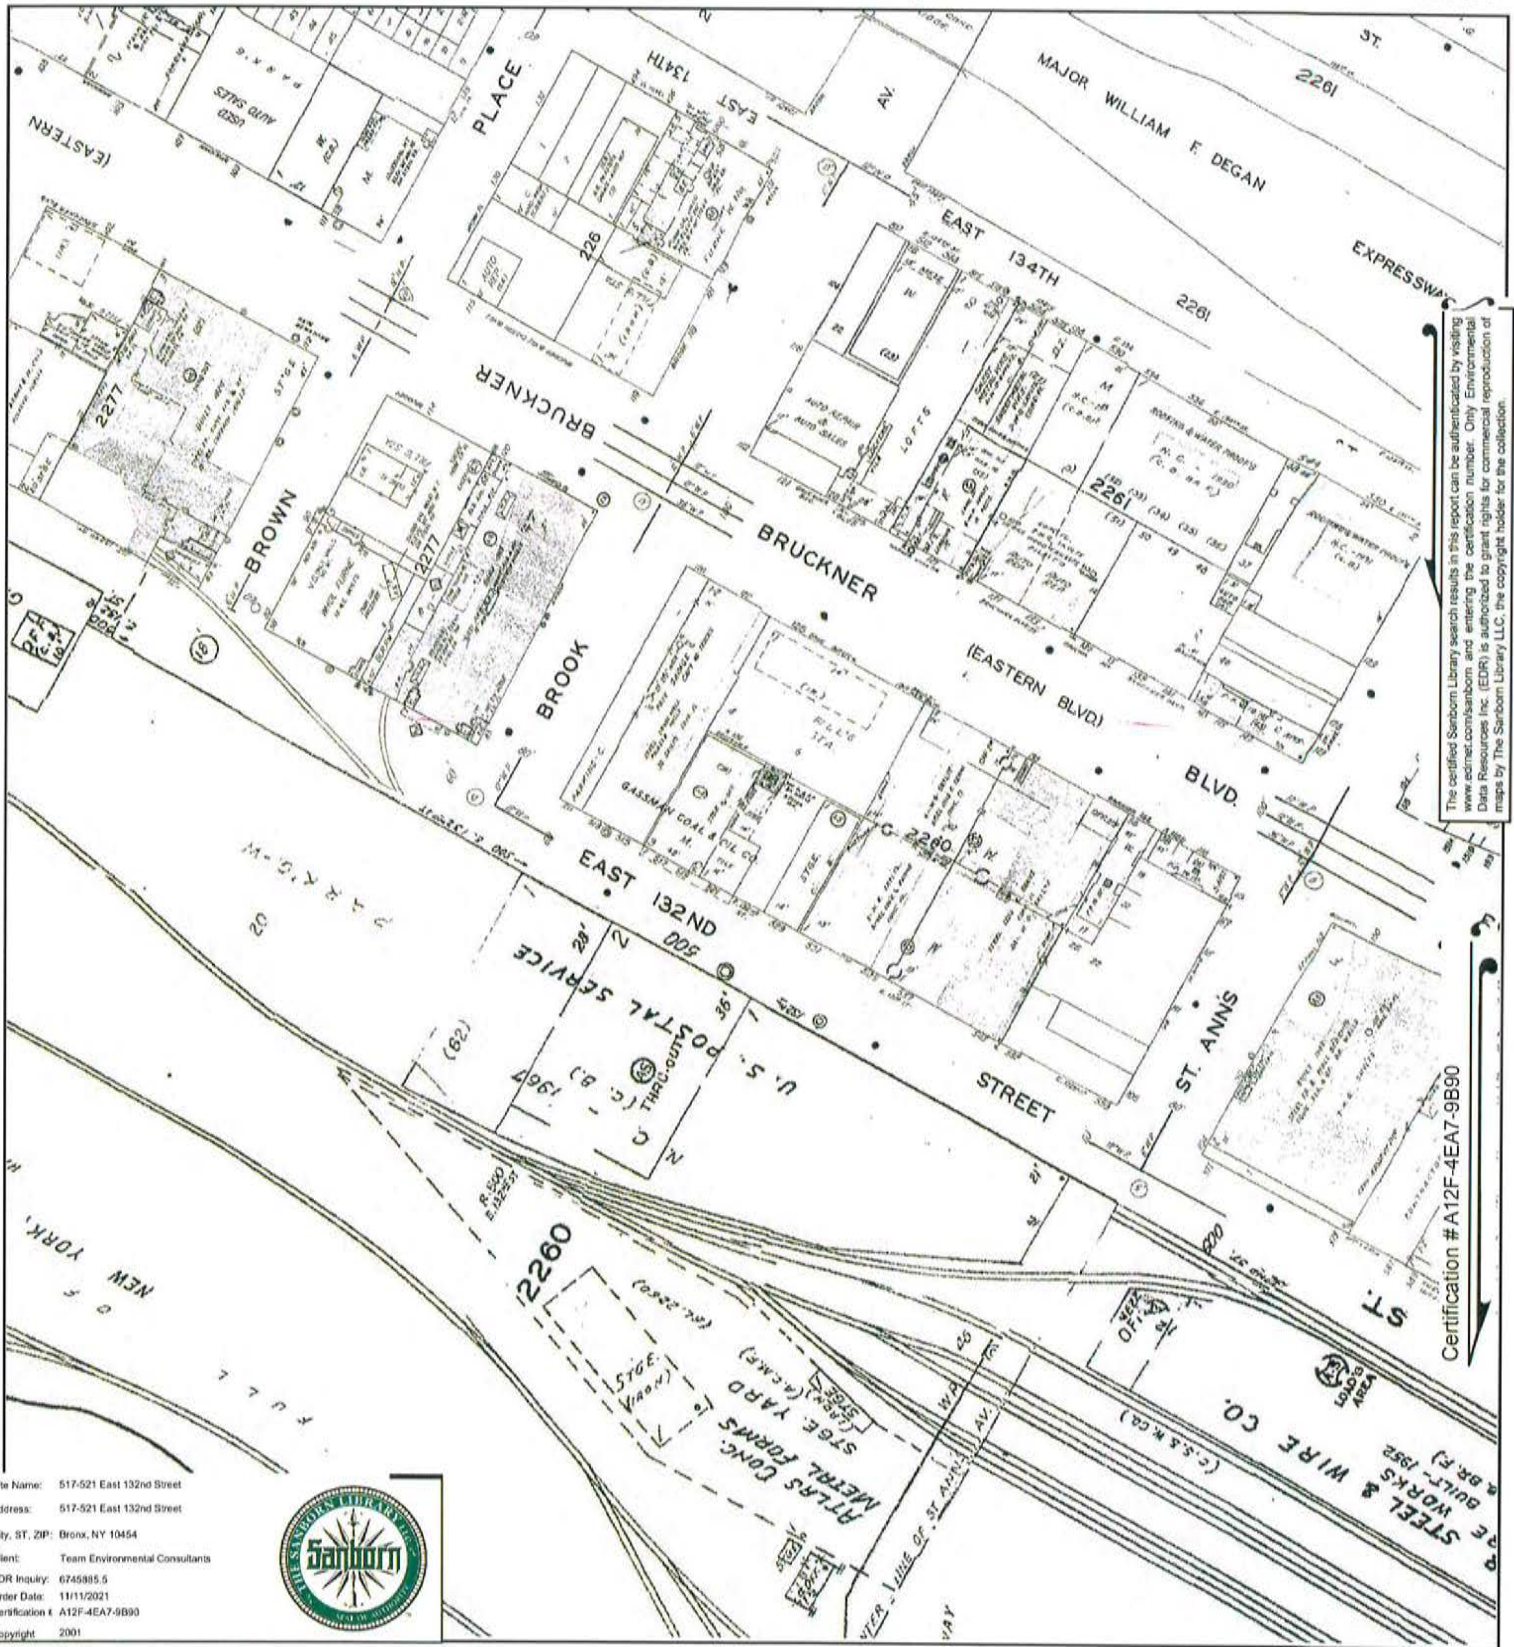

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 2001




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6

The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A12F-4EA7-9B90

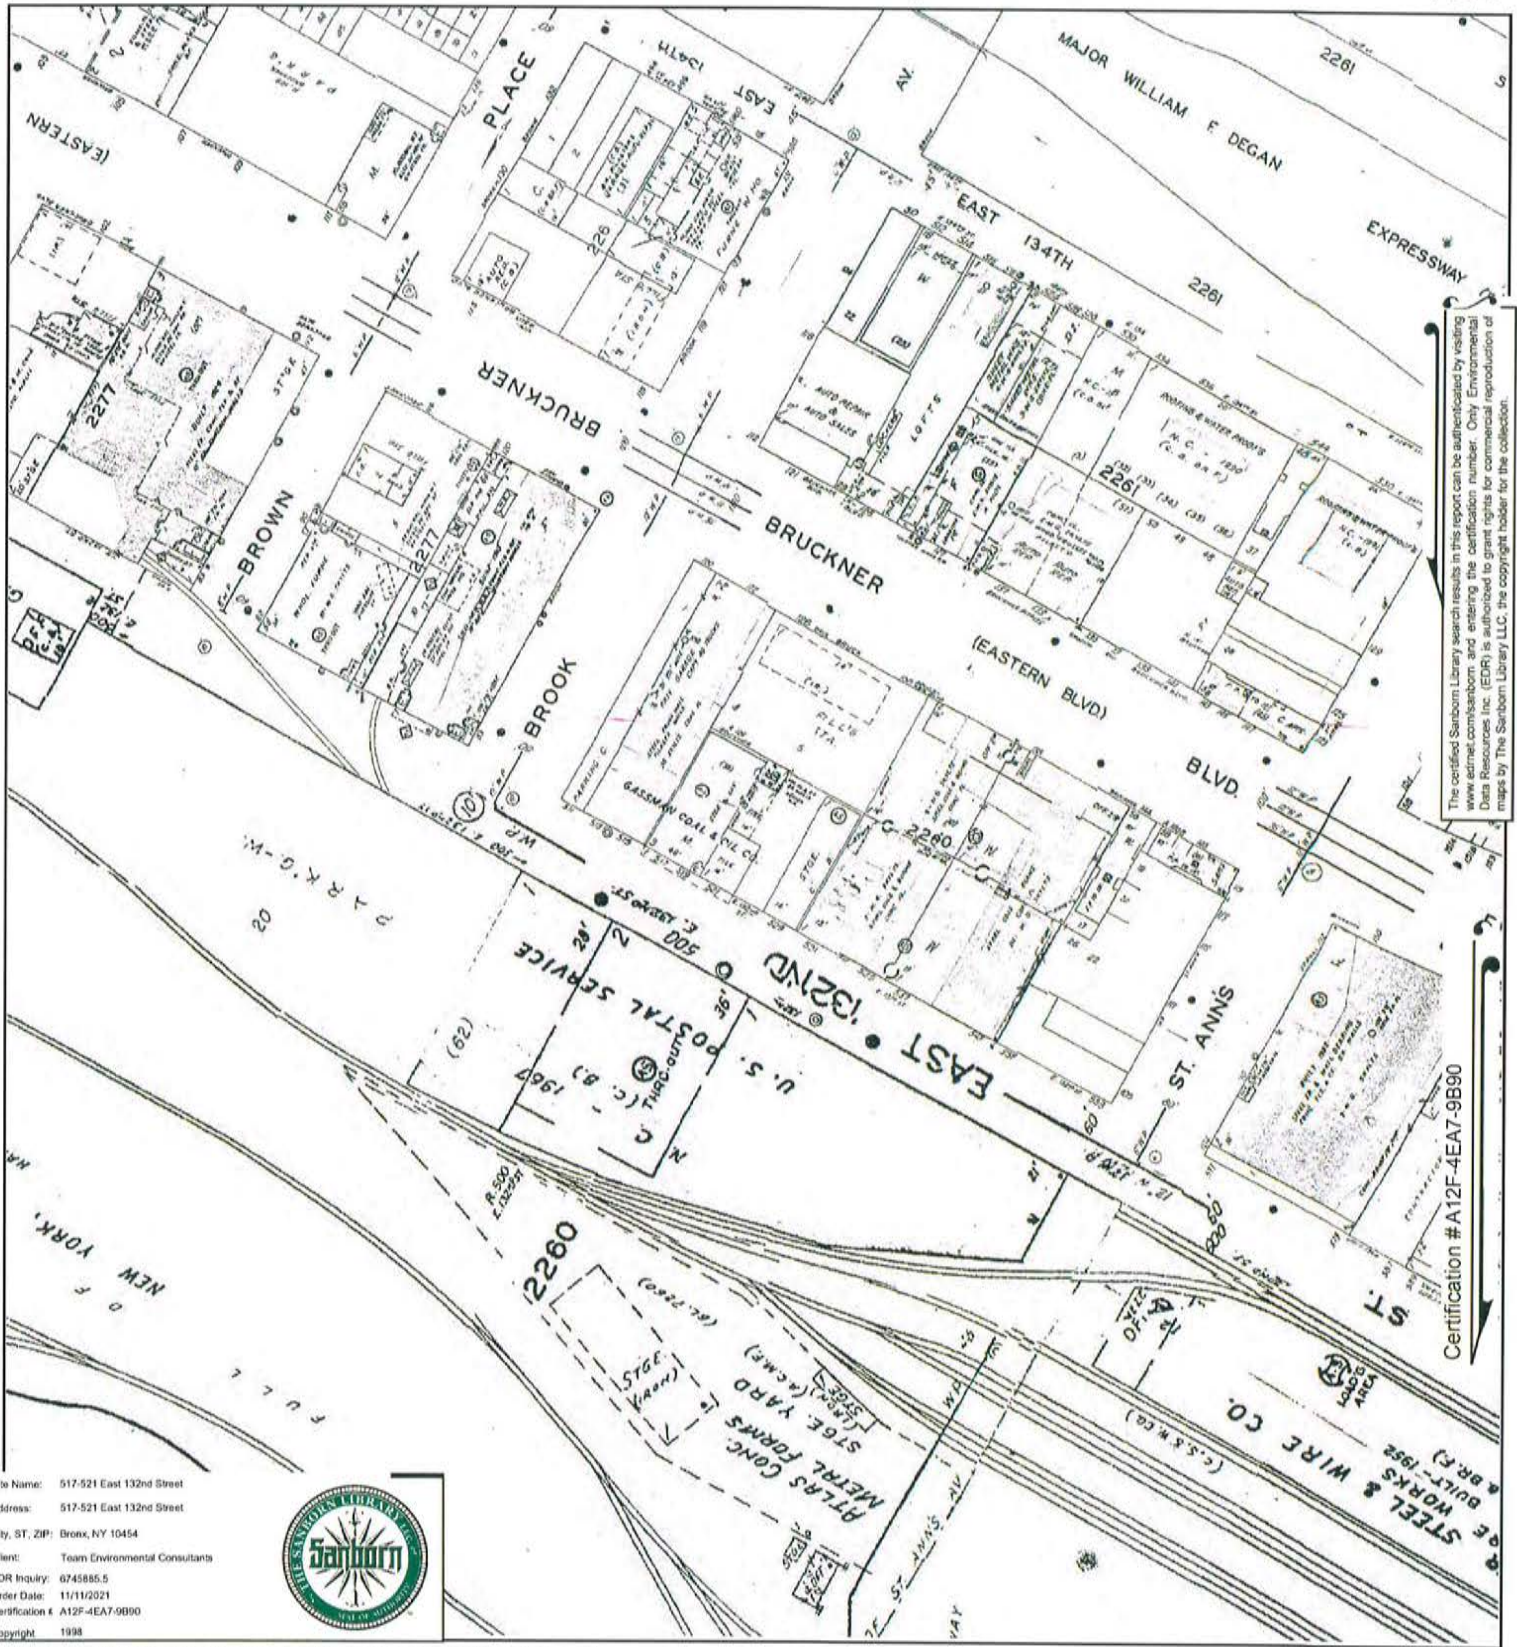

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Brooklyn, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1998




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6

The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A12F-4EA7-9B90

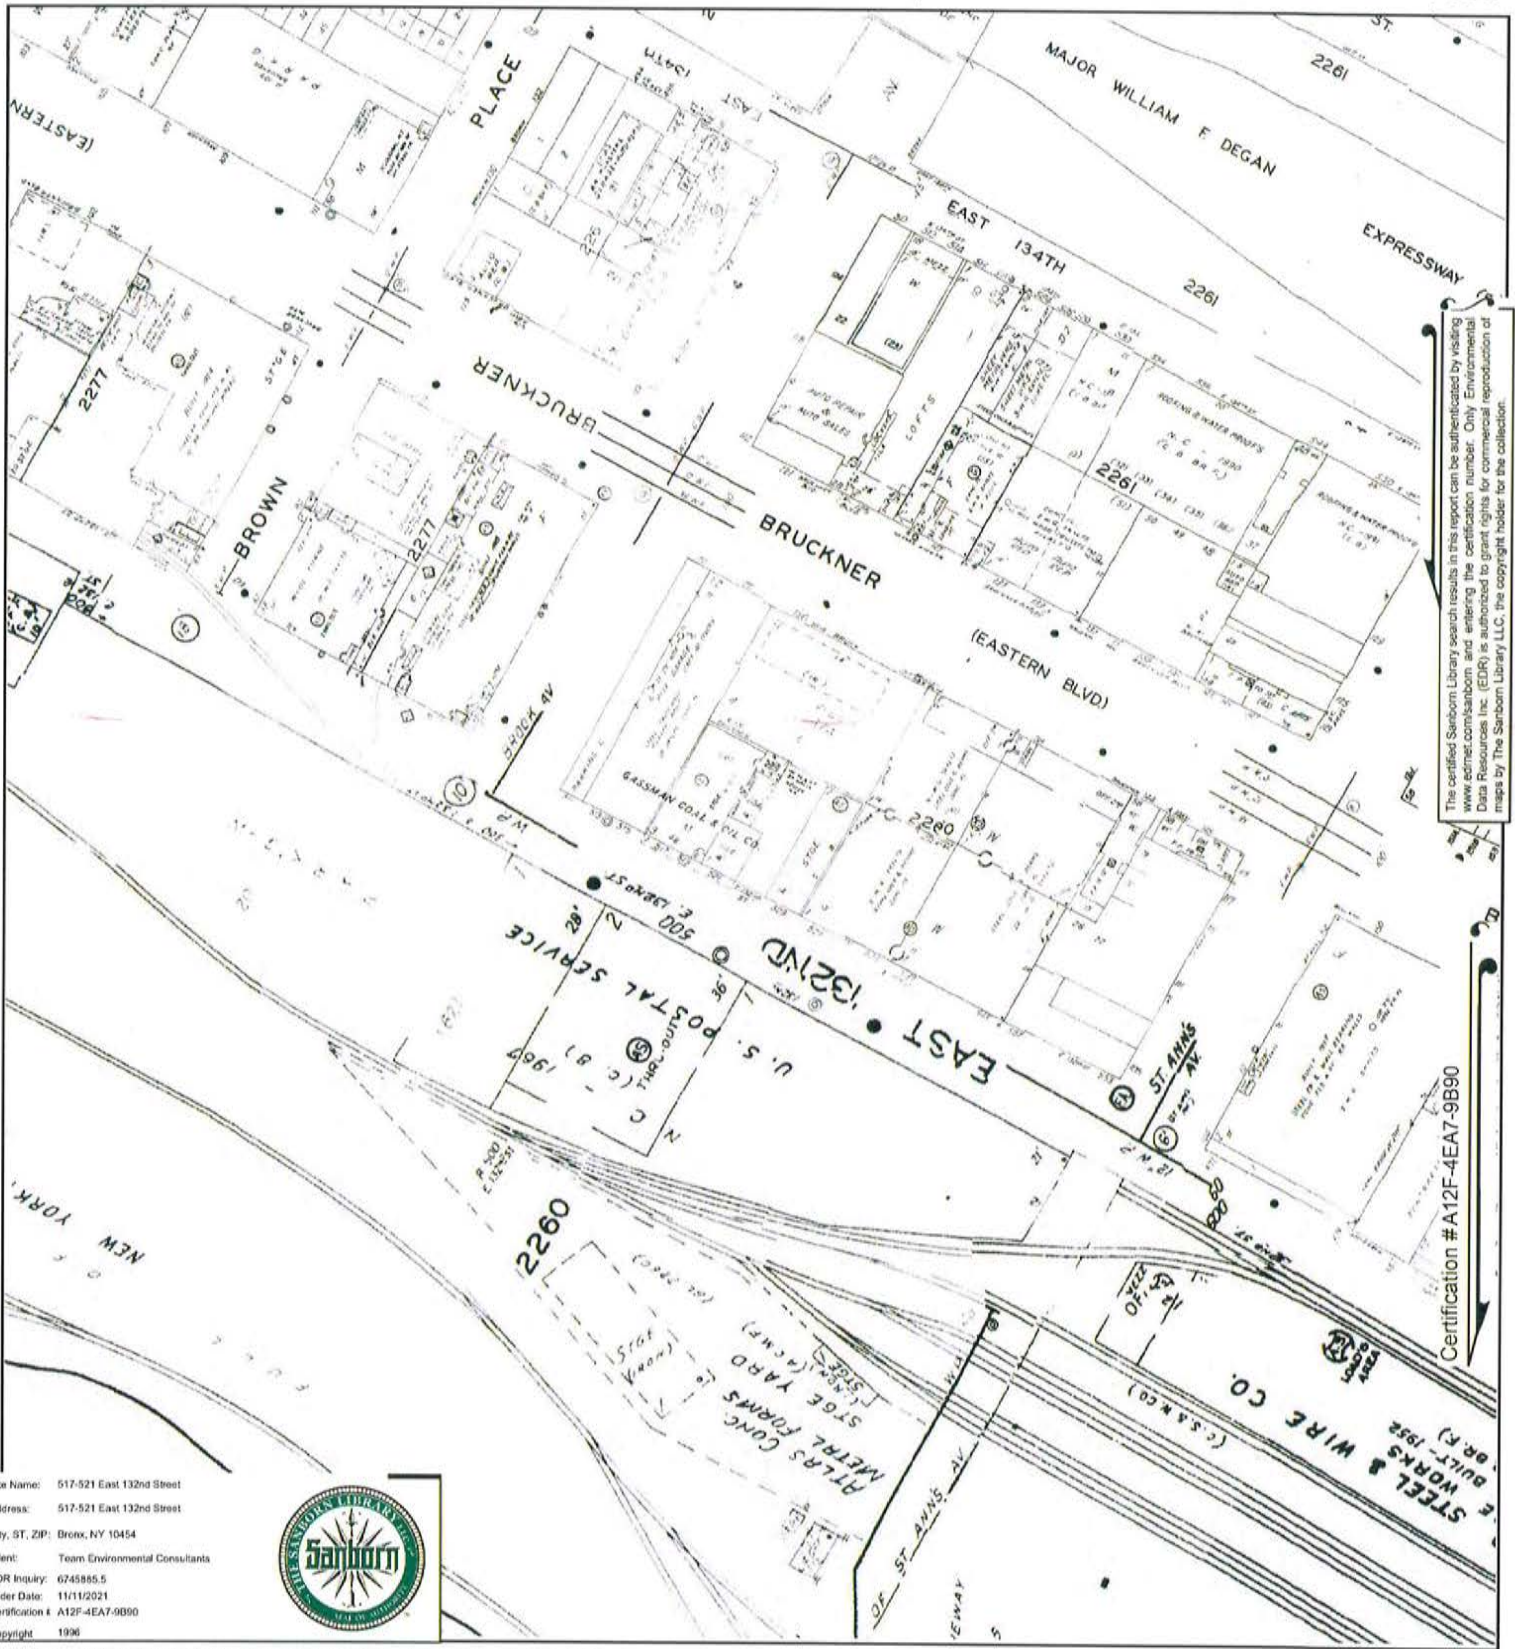

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2031
 Certification #: A12F-4EA7-9B90
 Copyright: 1996




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6

0 Feet 150 300 600



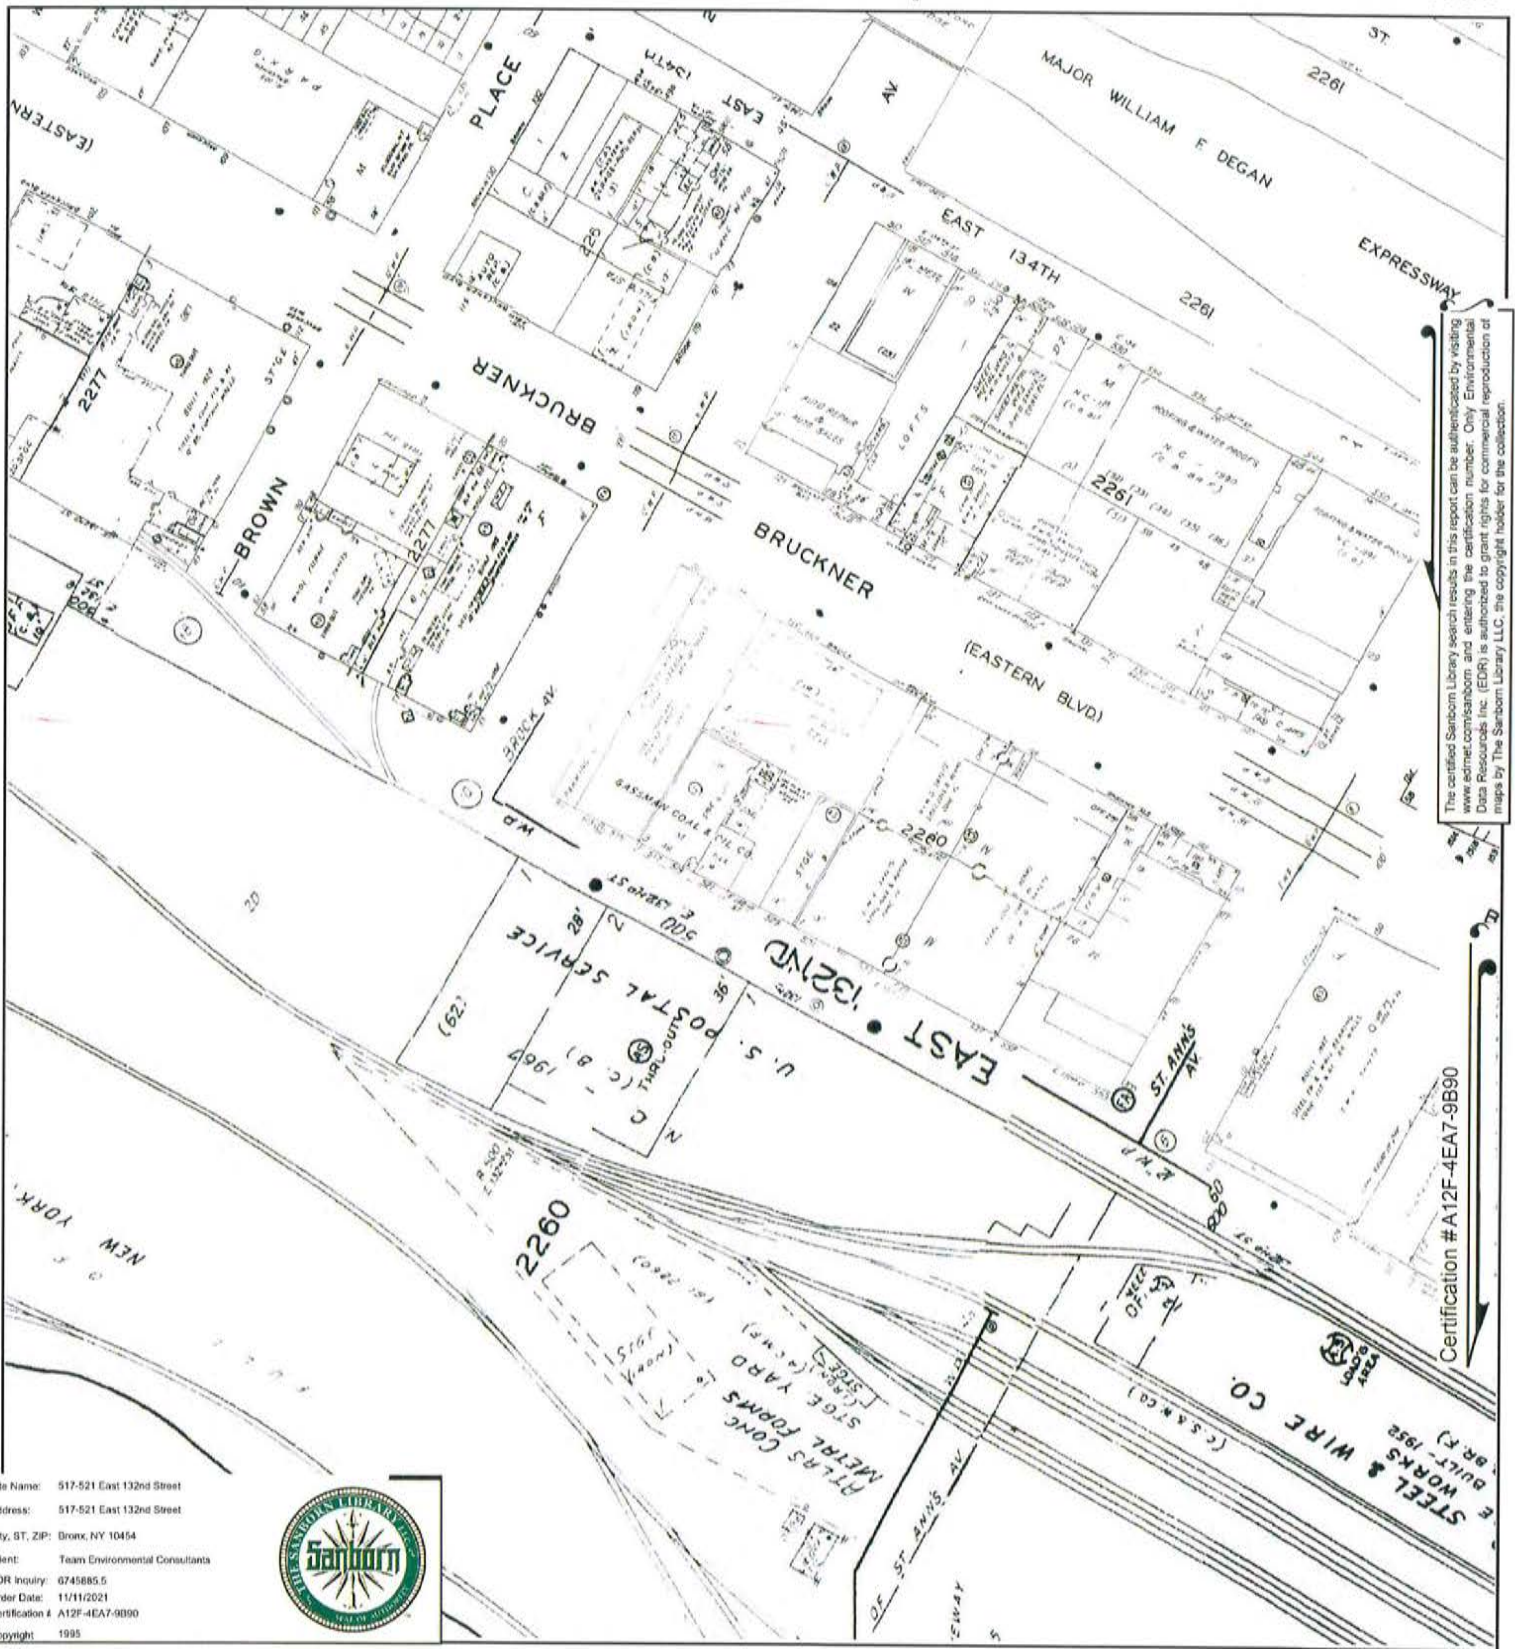

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1995



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6

0 Feet 150 300 600




The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A12F-4EA7-9B90




N

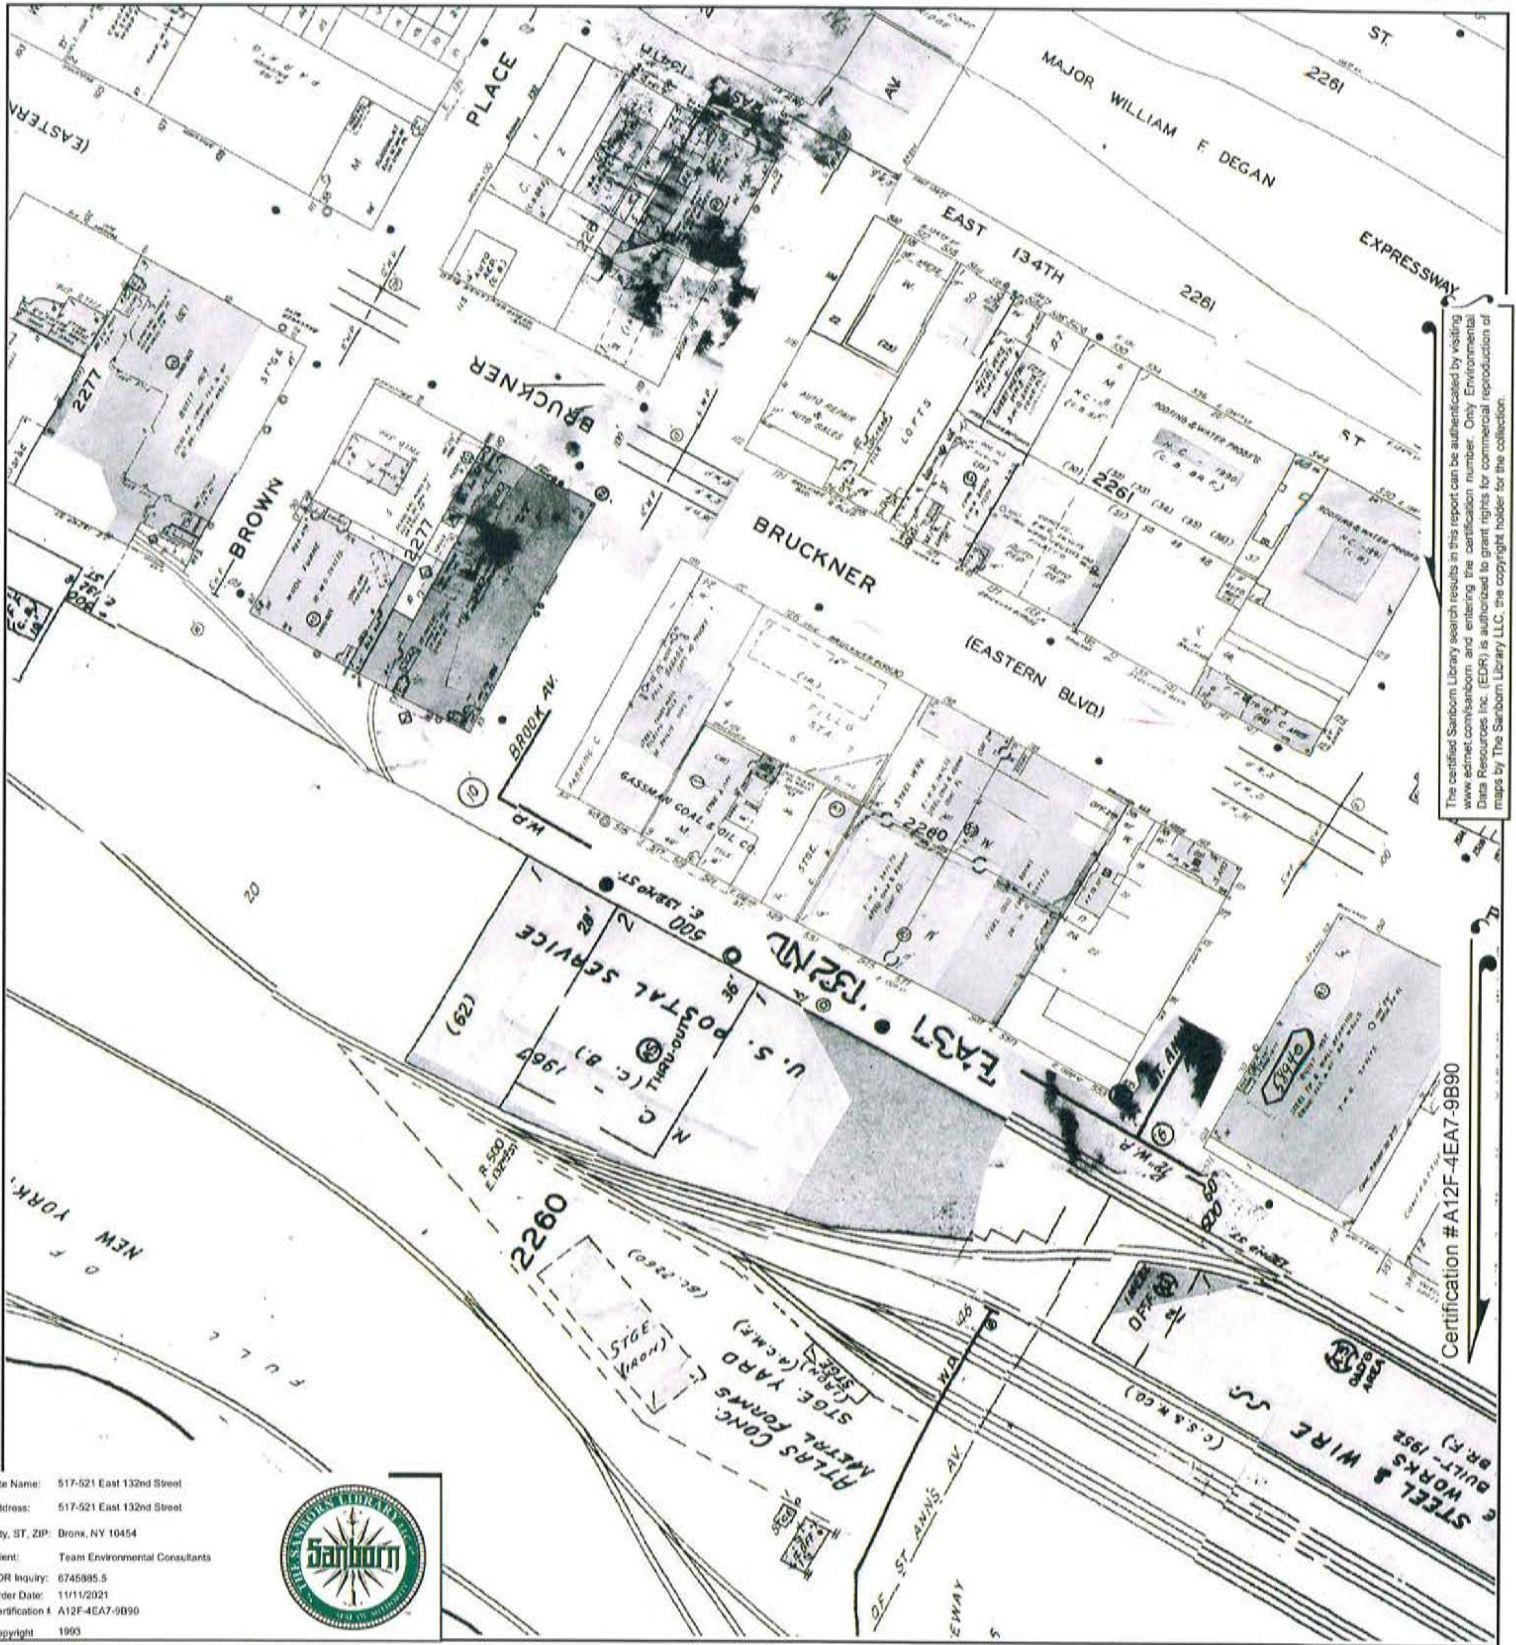


Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1993




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

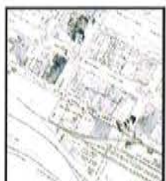

Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6




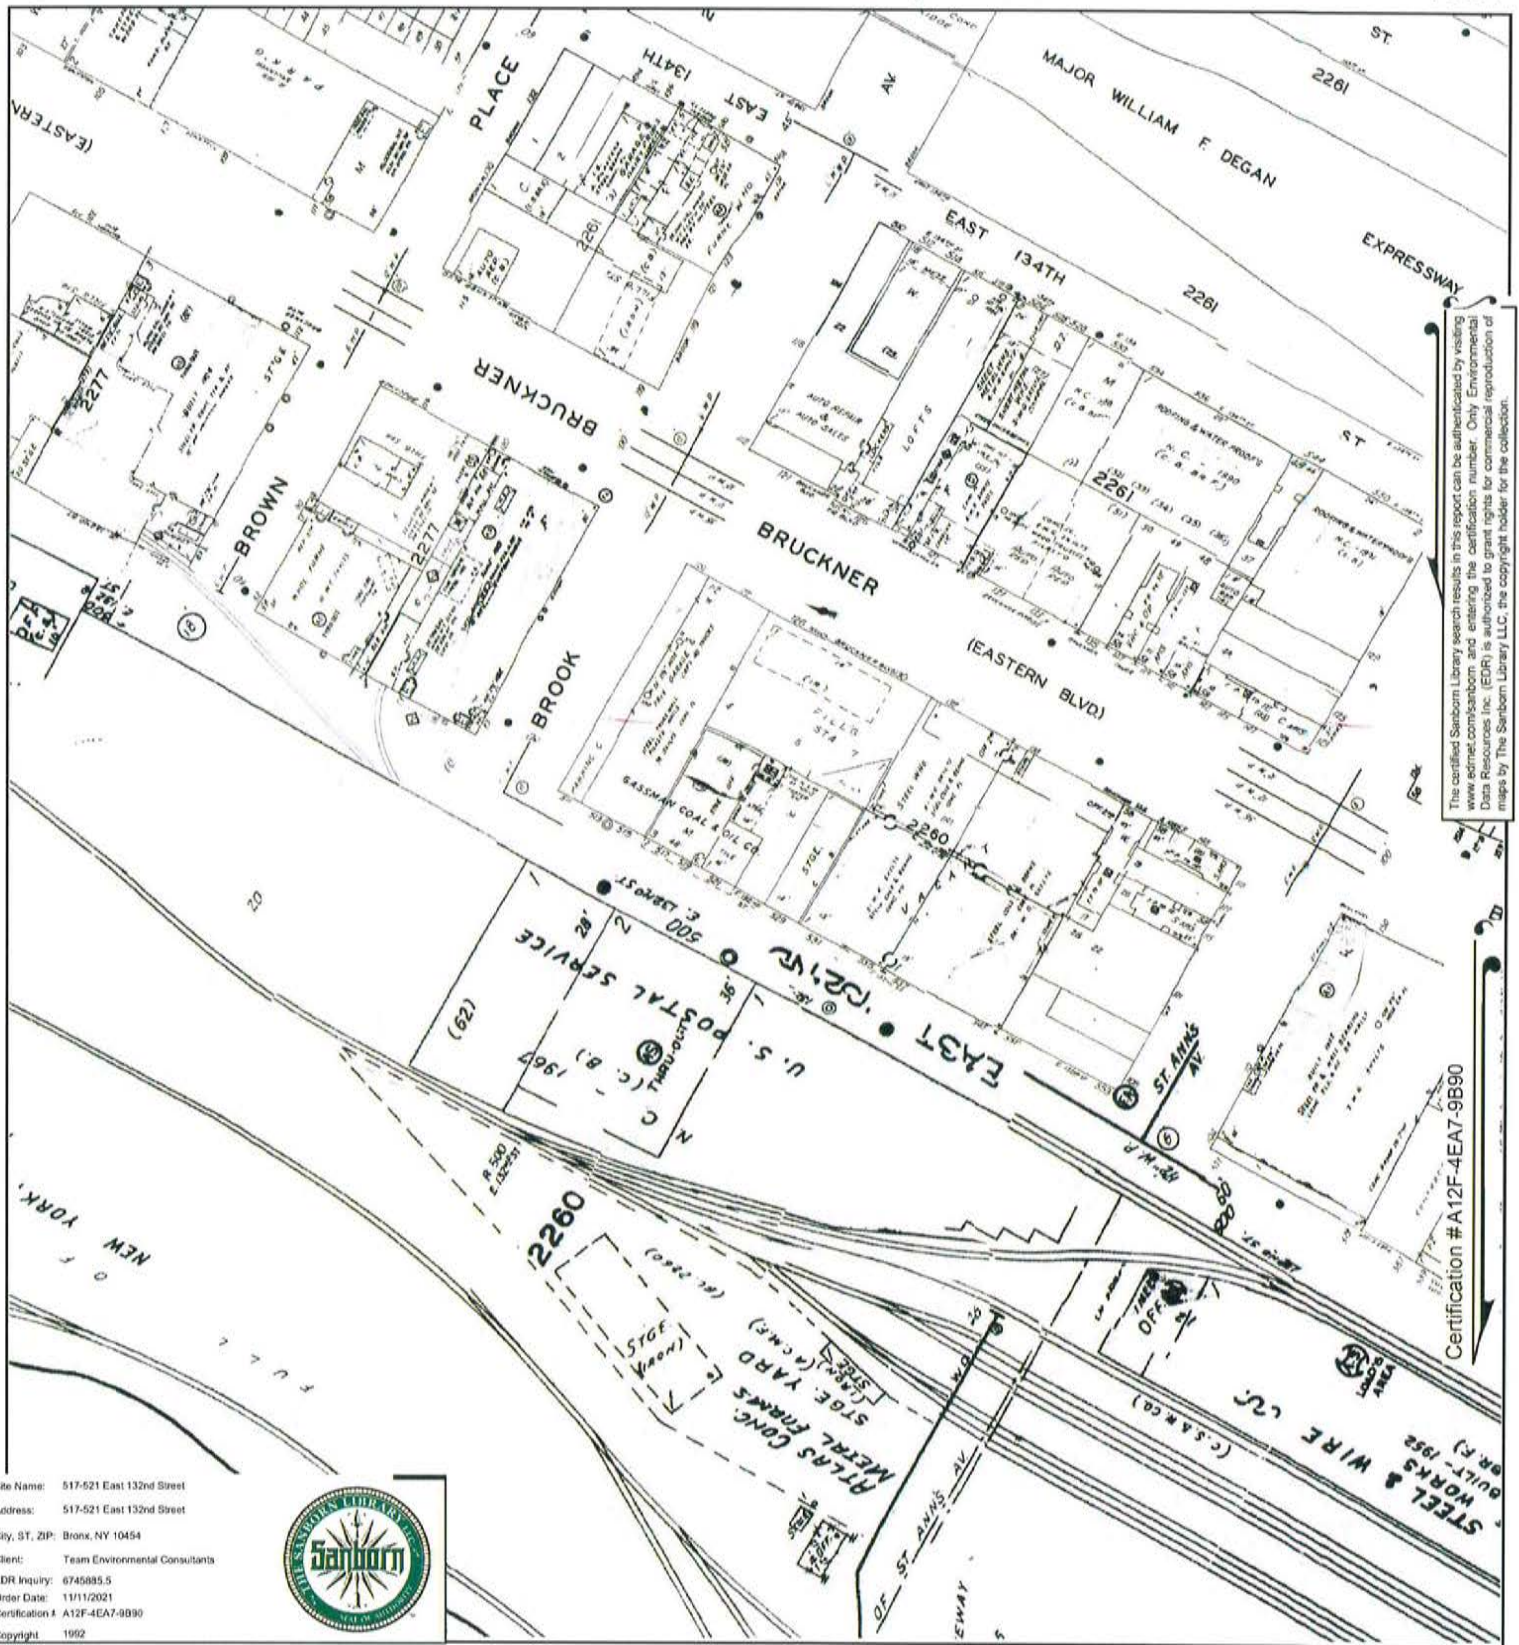


Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1992



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 9S, Sheet 7
 Volume 9S, Sheet 6
 Volume 9S, Sheet 16
 Volume 9S, Sheet 13

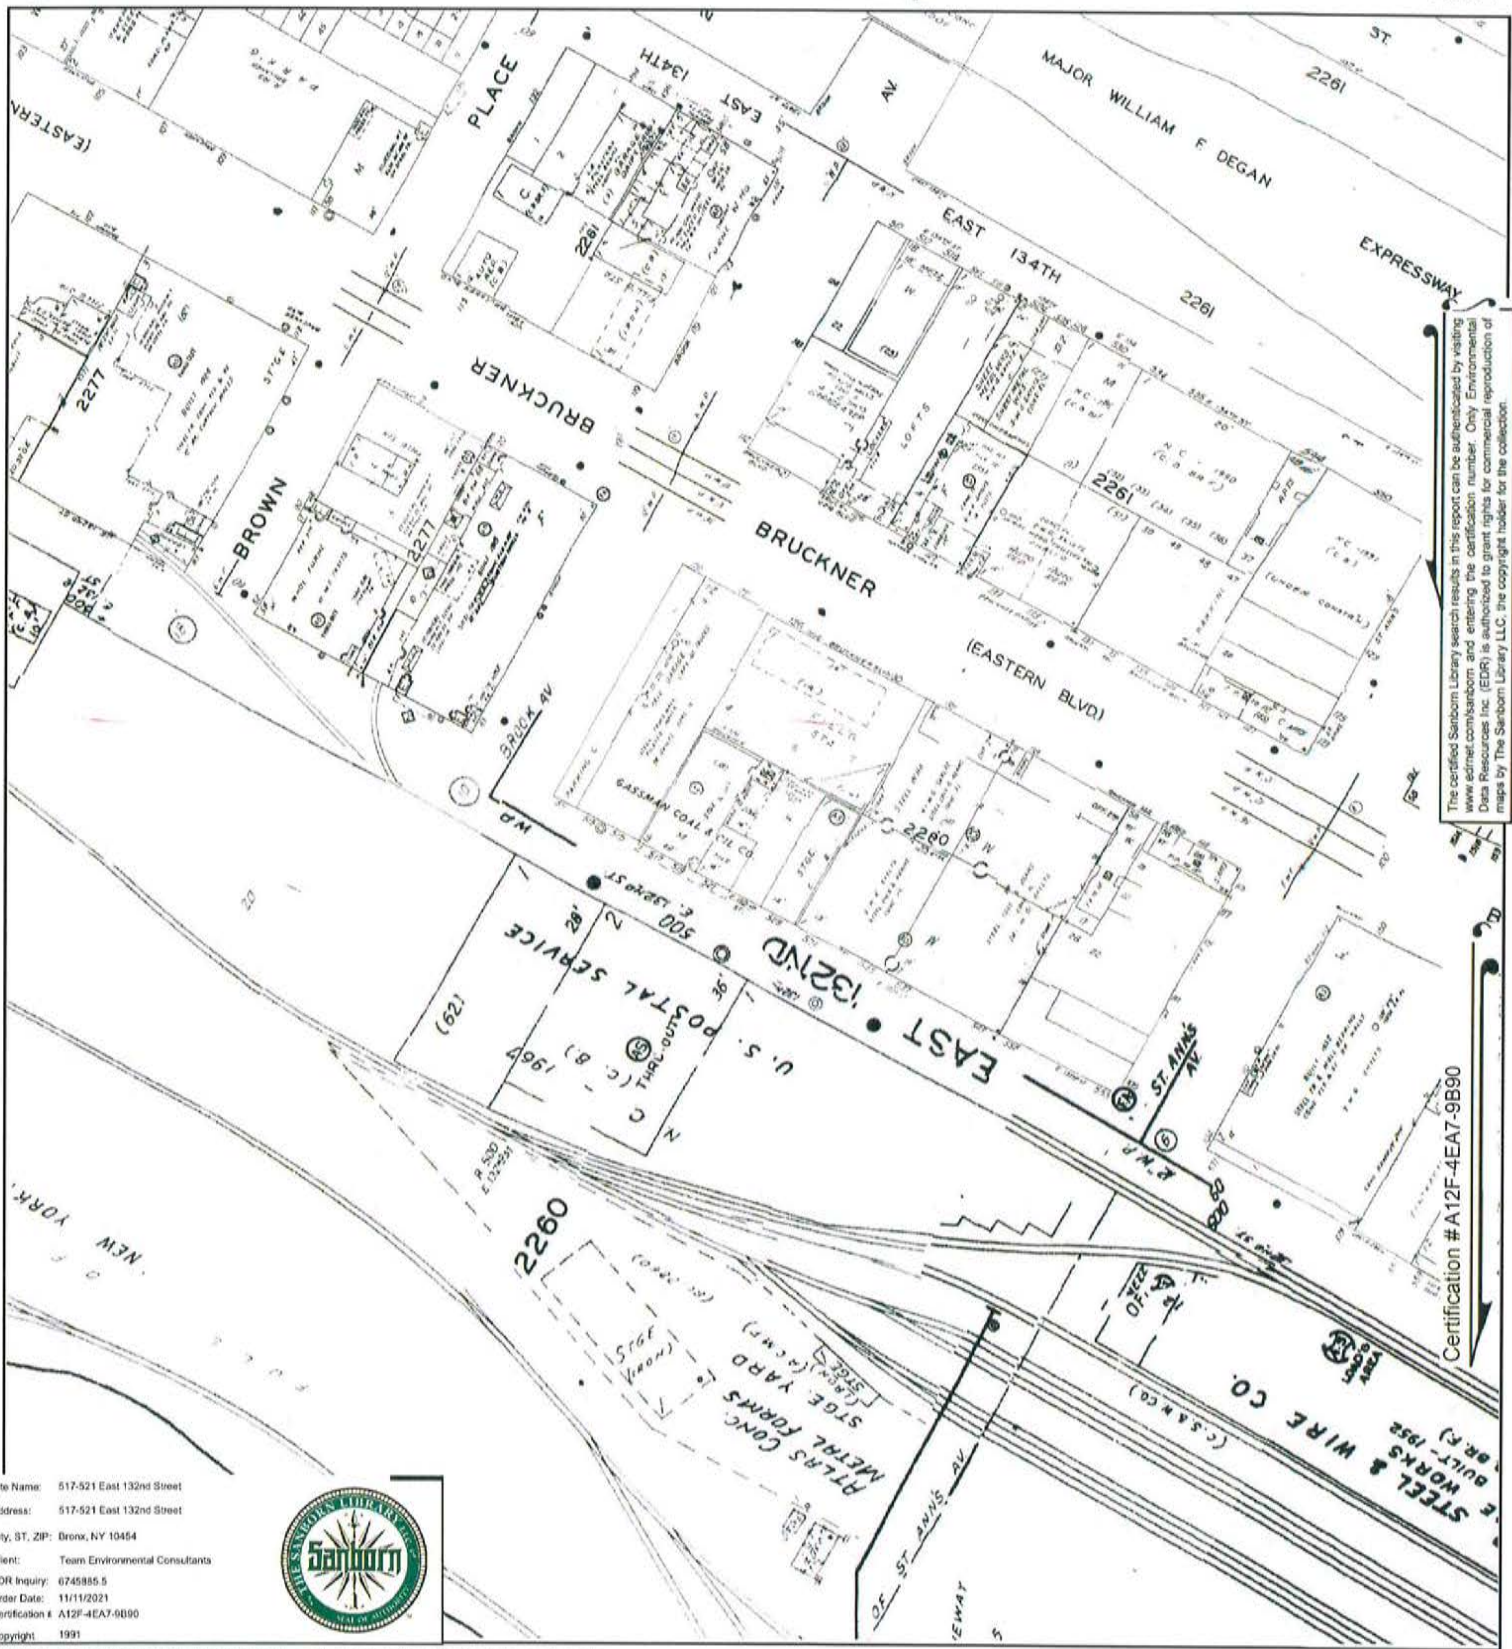


The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A12F-4EA7-9B90


Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1991



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 9S, Sheet 7
 Volume 9S, Sheet 6
 Volume 9S, Sheet 16
 Volume 9S, Sheet 13

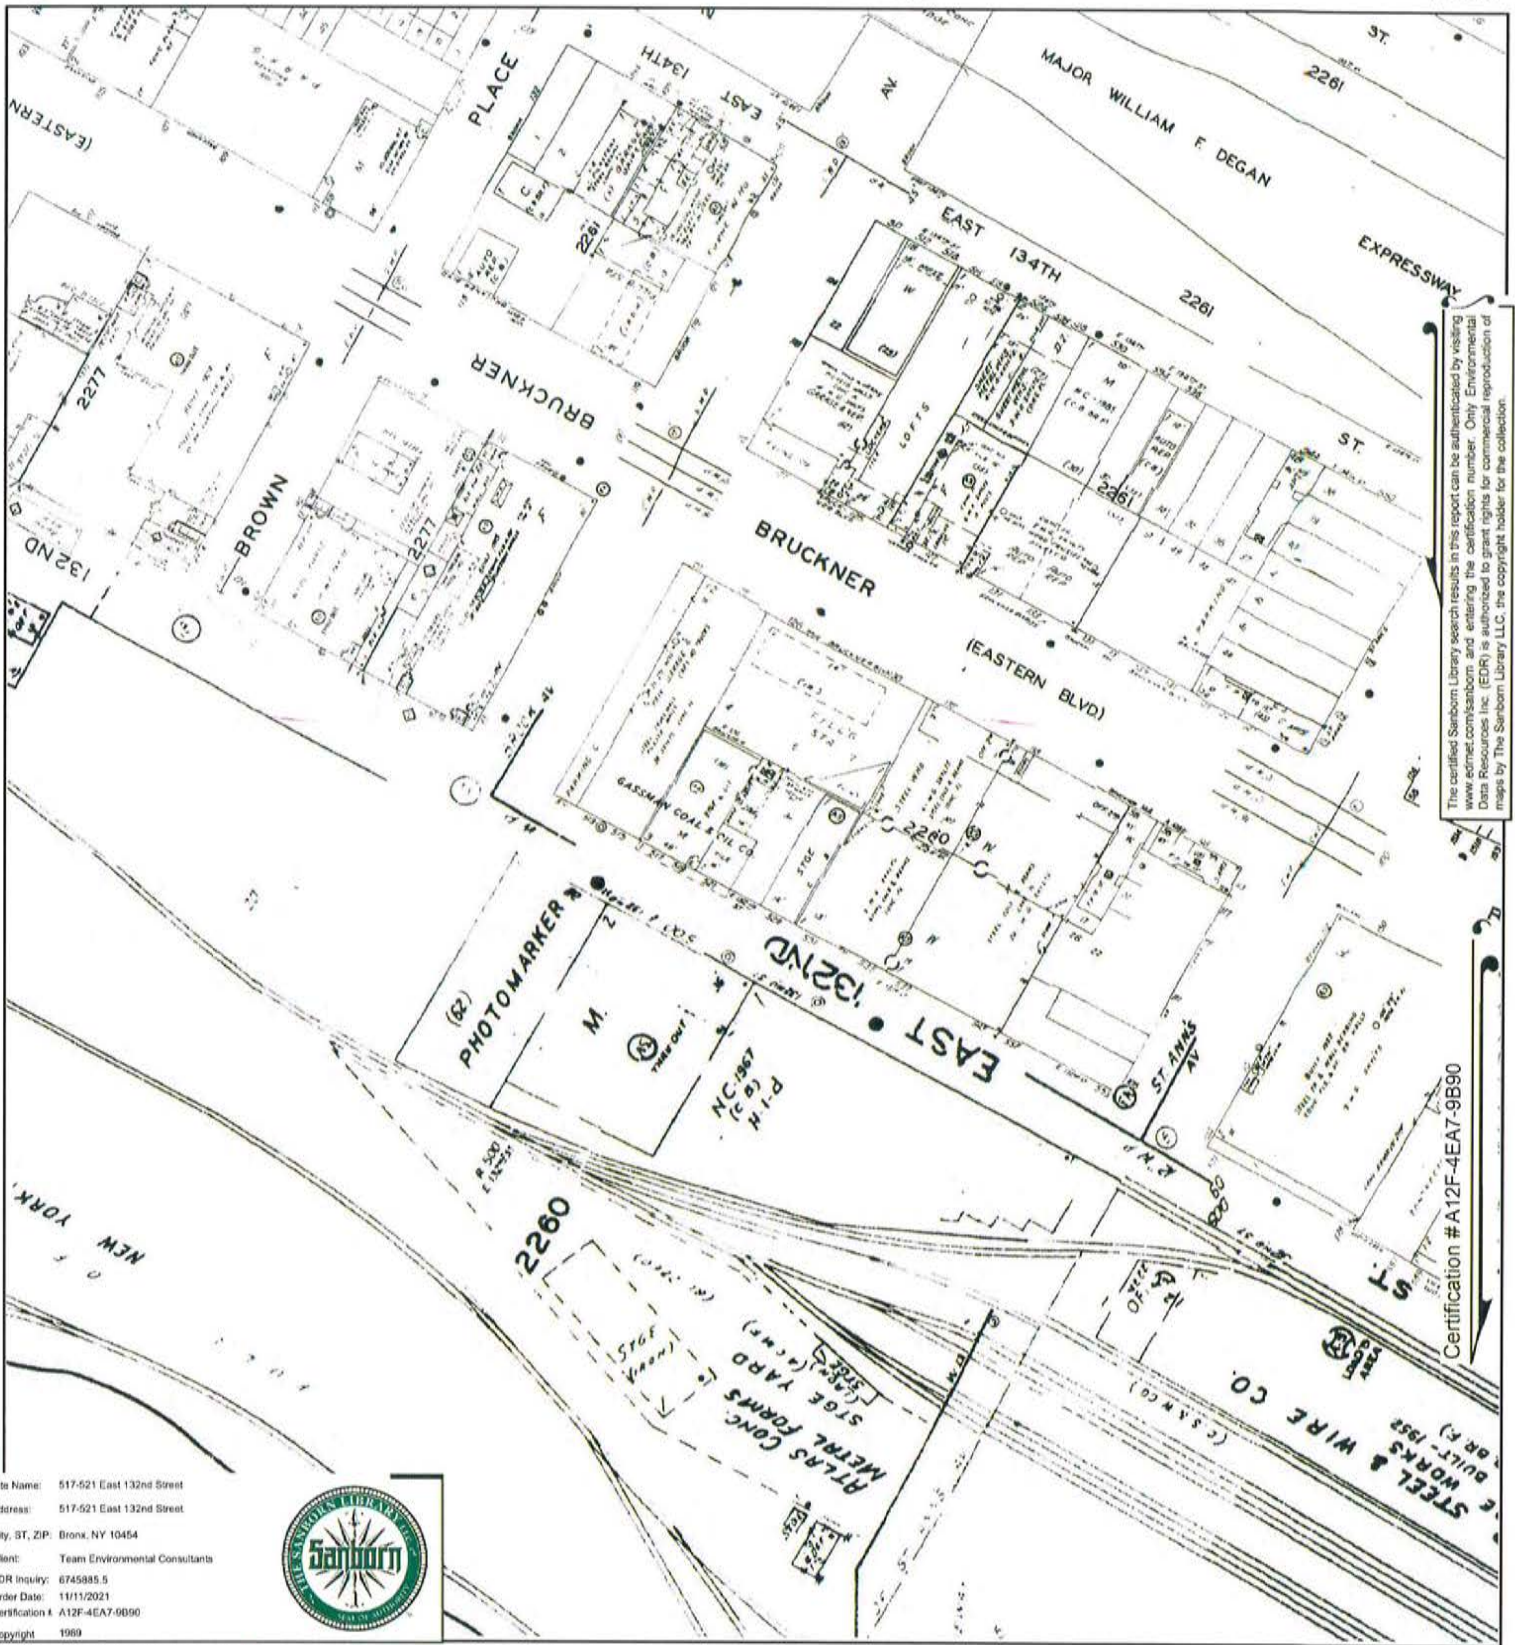



The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A12F-4EA7-9B90


Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification: A12F-4EA7-9B90
 Copyright: 1989



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

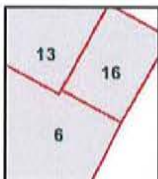

Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 6

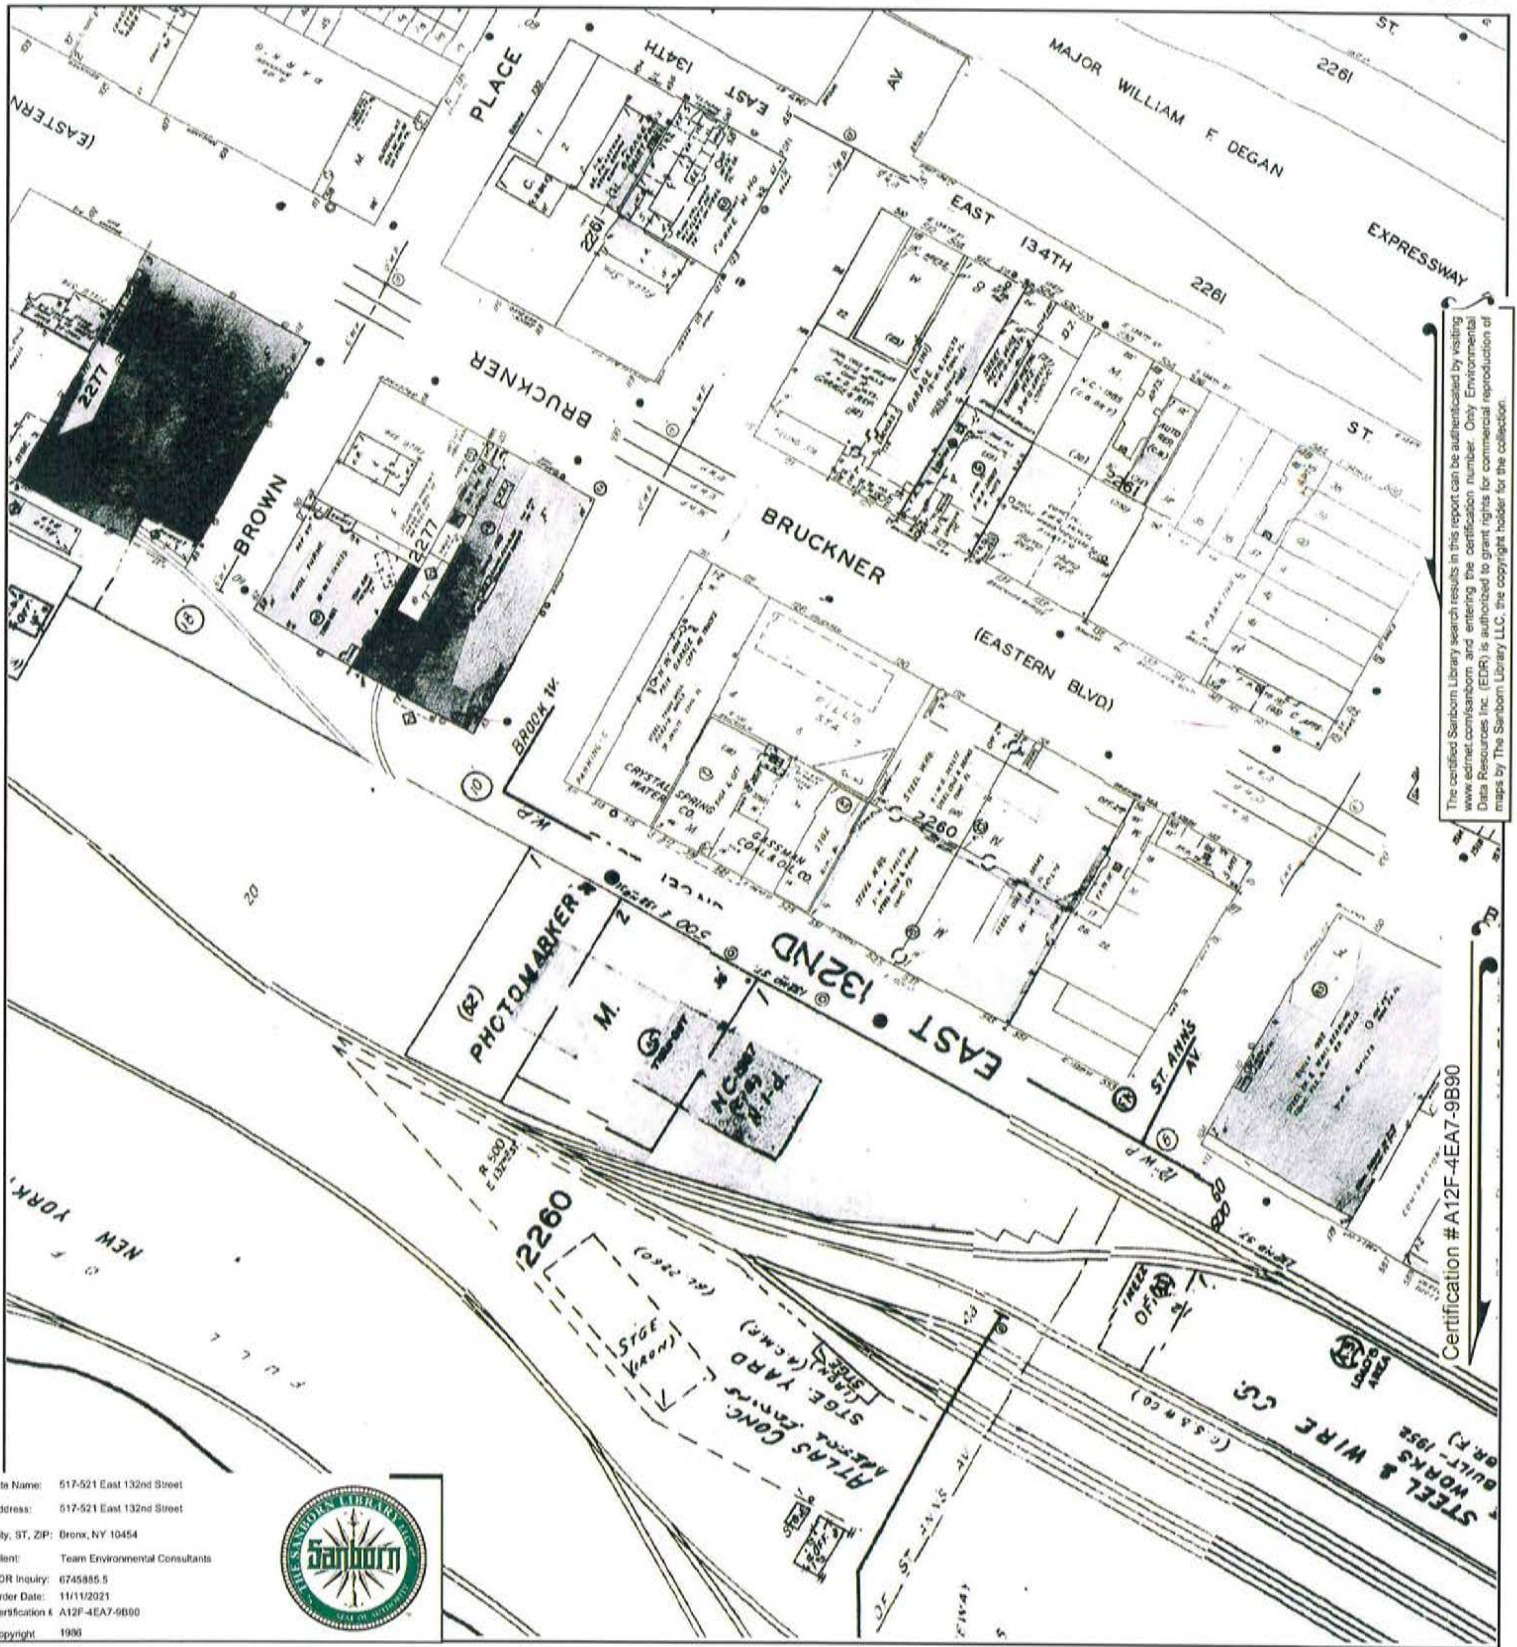



The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A12F-4EA7-9B90


Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification: A12F-4EA7-9B90
 Copyright: 1990



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

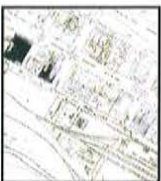


Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6

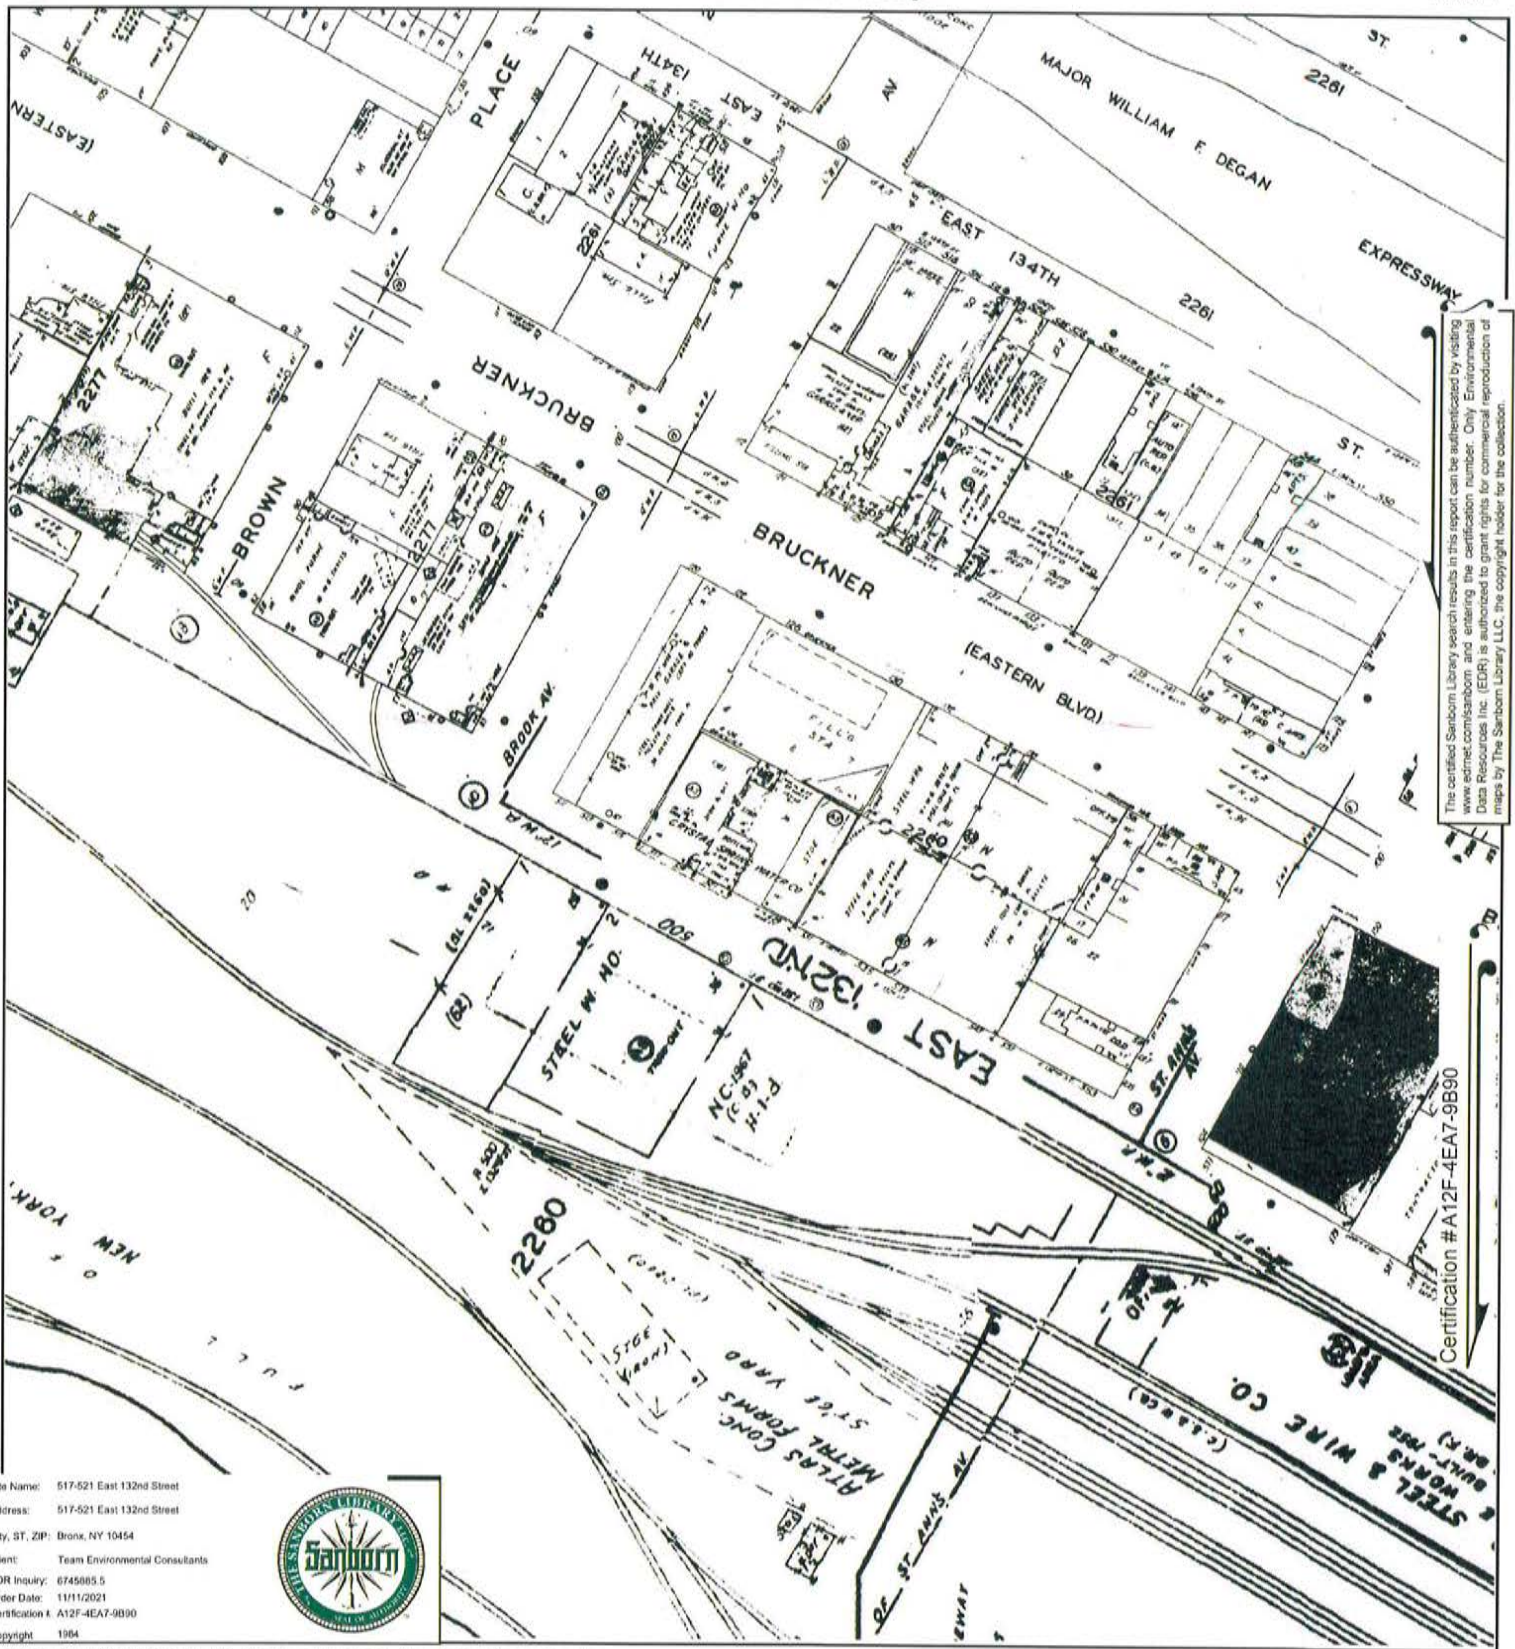

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1984




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 9S, Sheet 13
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6
 Volume 9S, Sheet 16

This certified Sanborn Library search results in this report can be authorized by visiting
 www.edr.com/sanborn and entering the certification number. Only Environmental
 Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of
 maps by The Sanborn Library LLC, the copyright holder for the collection.


Certification #A12F-4EA7-9B90

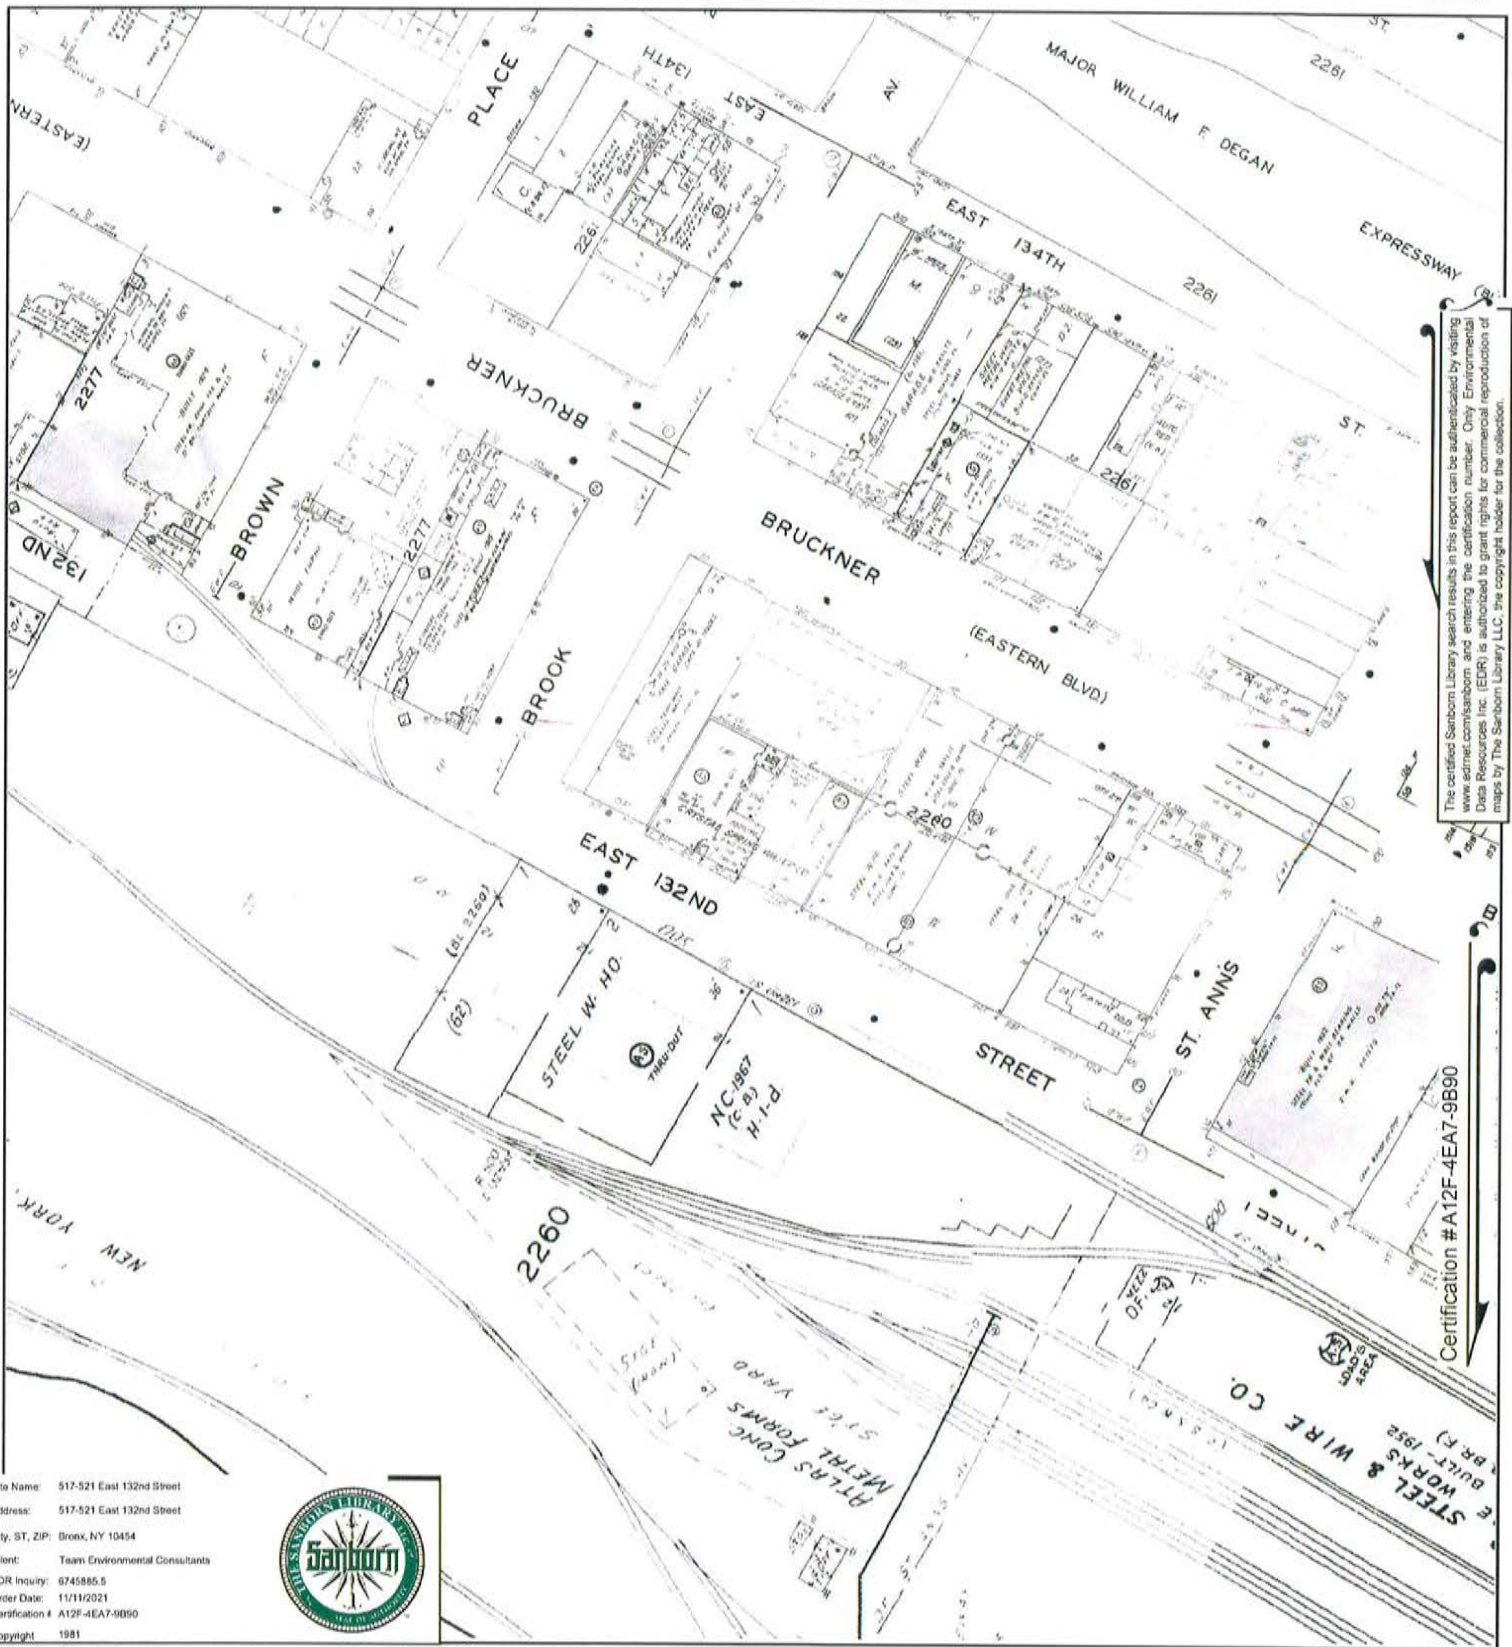


Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1981



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.




Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6

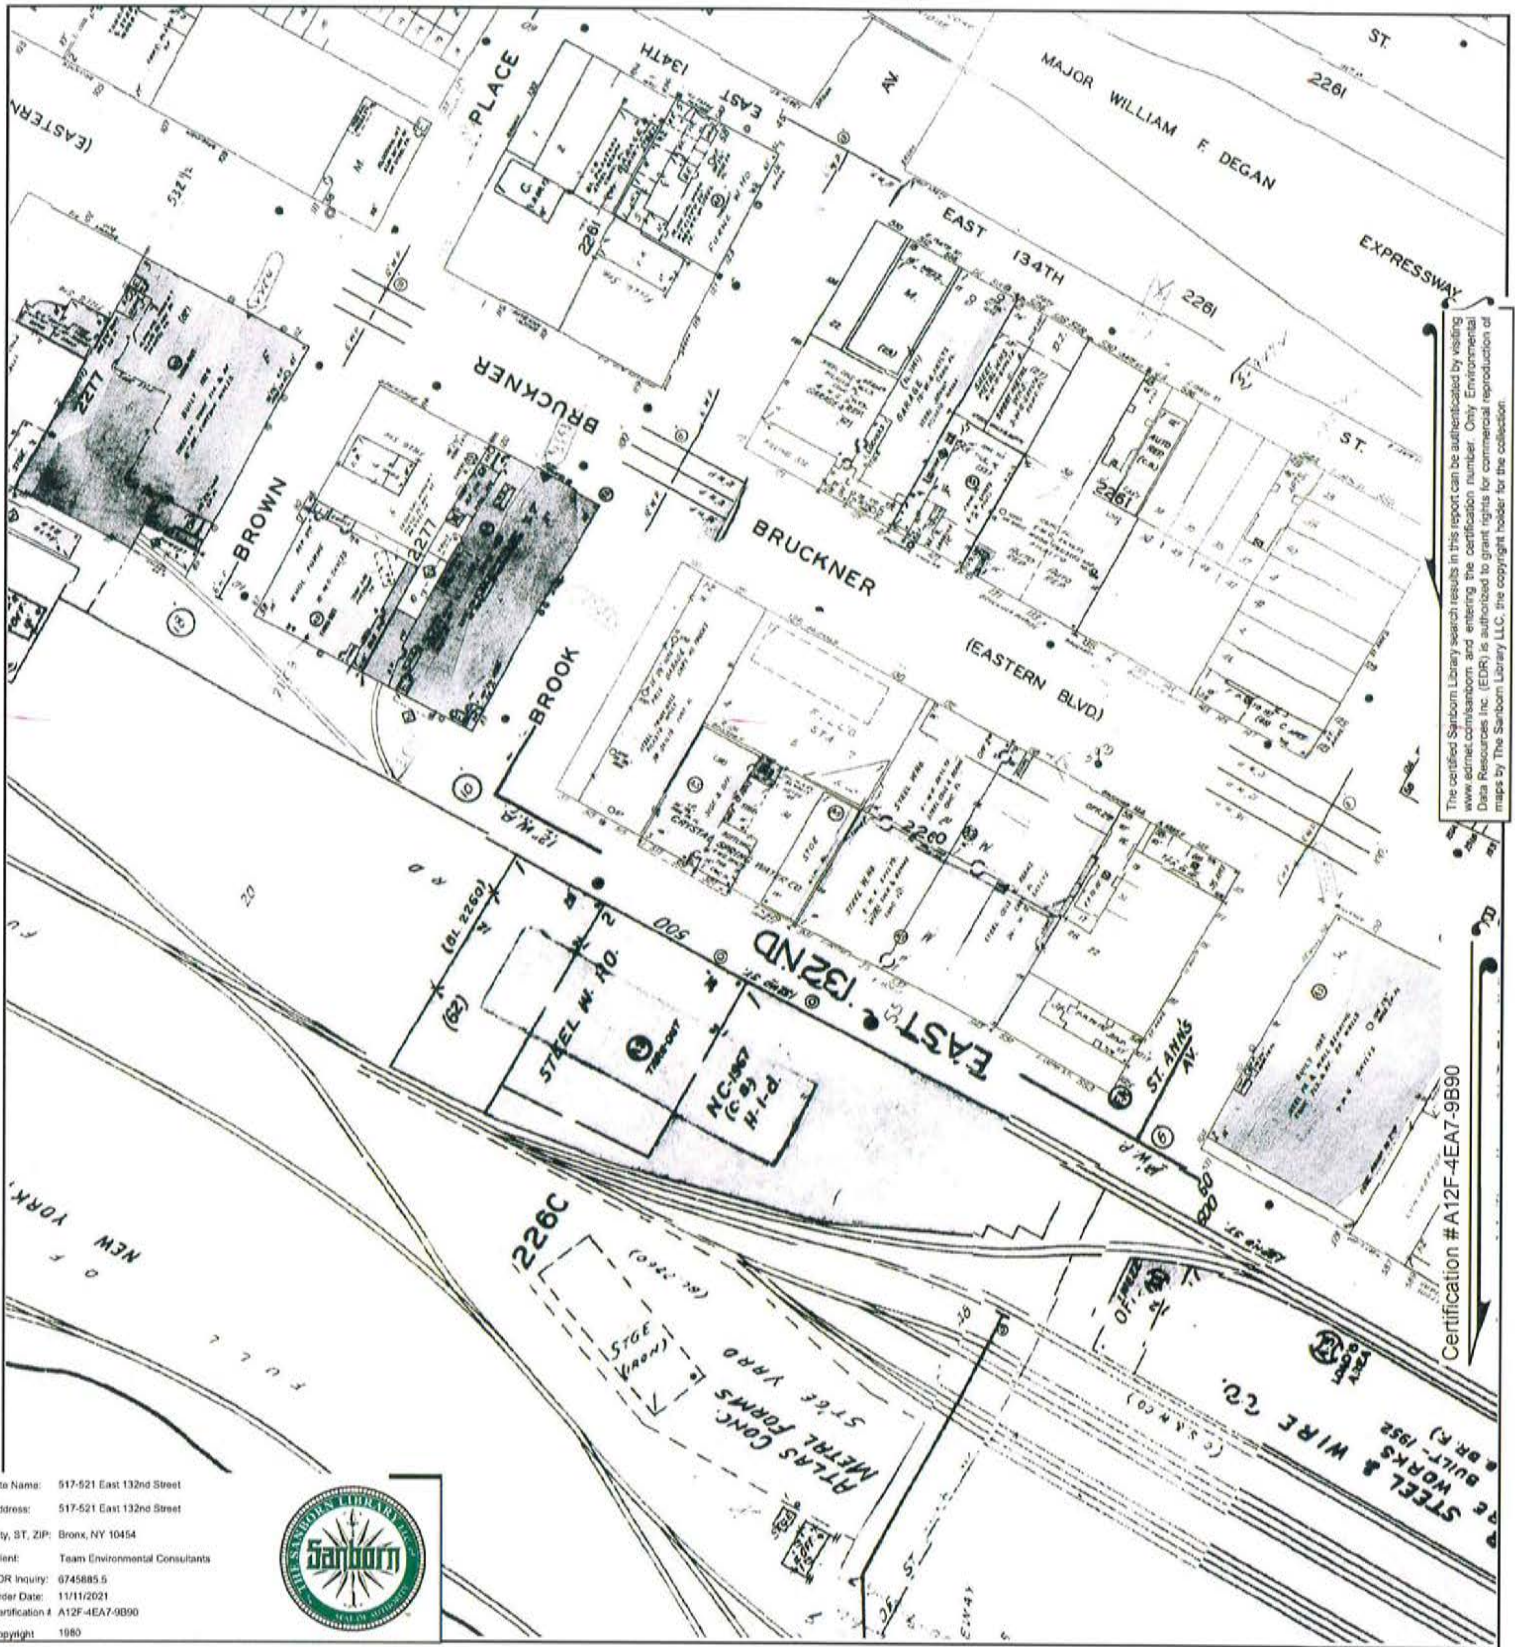

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1980




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrmap.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A12F-4EA7-9B90

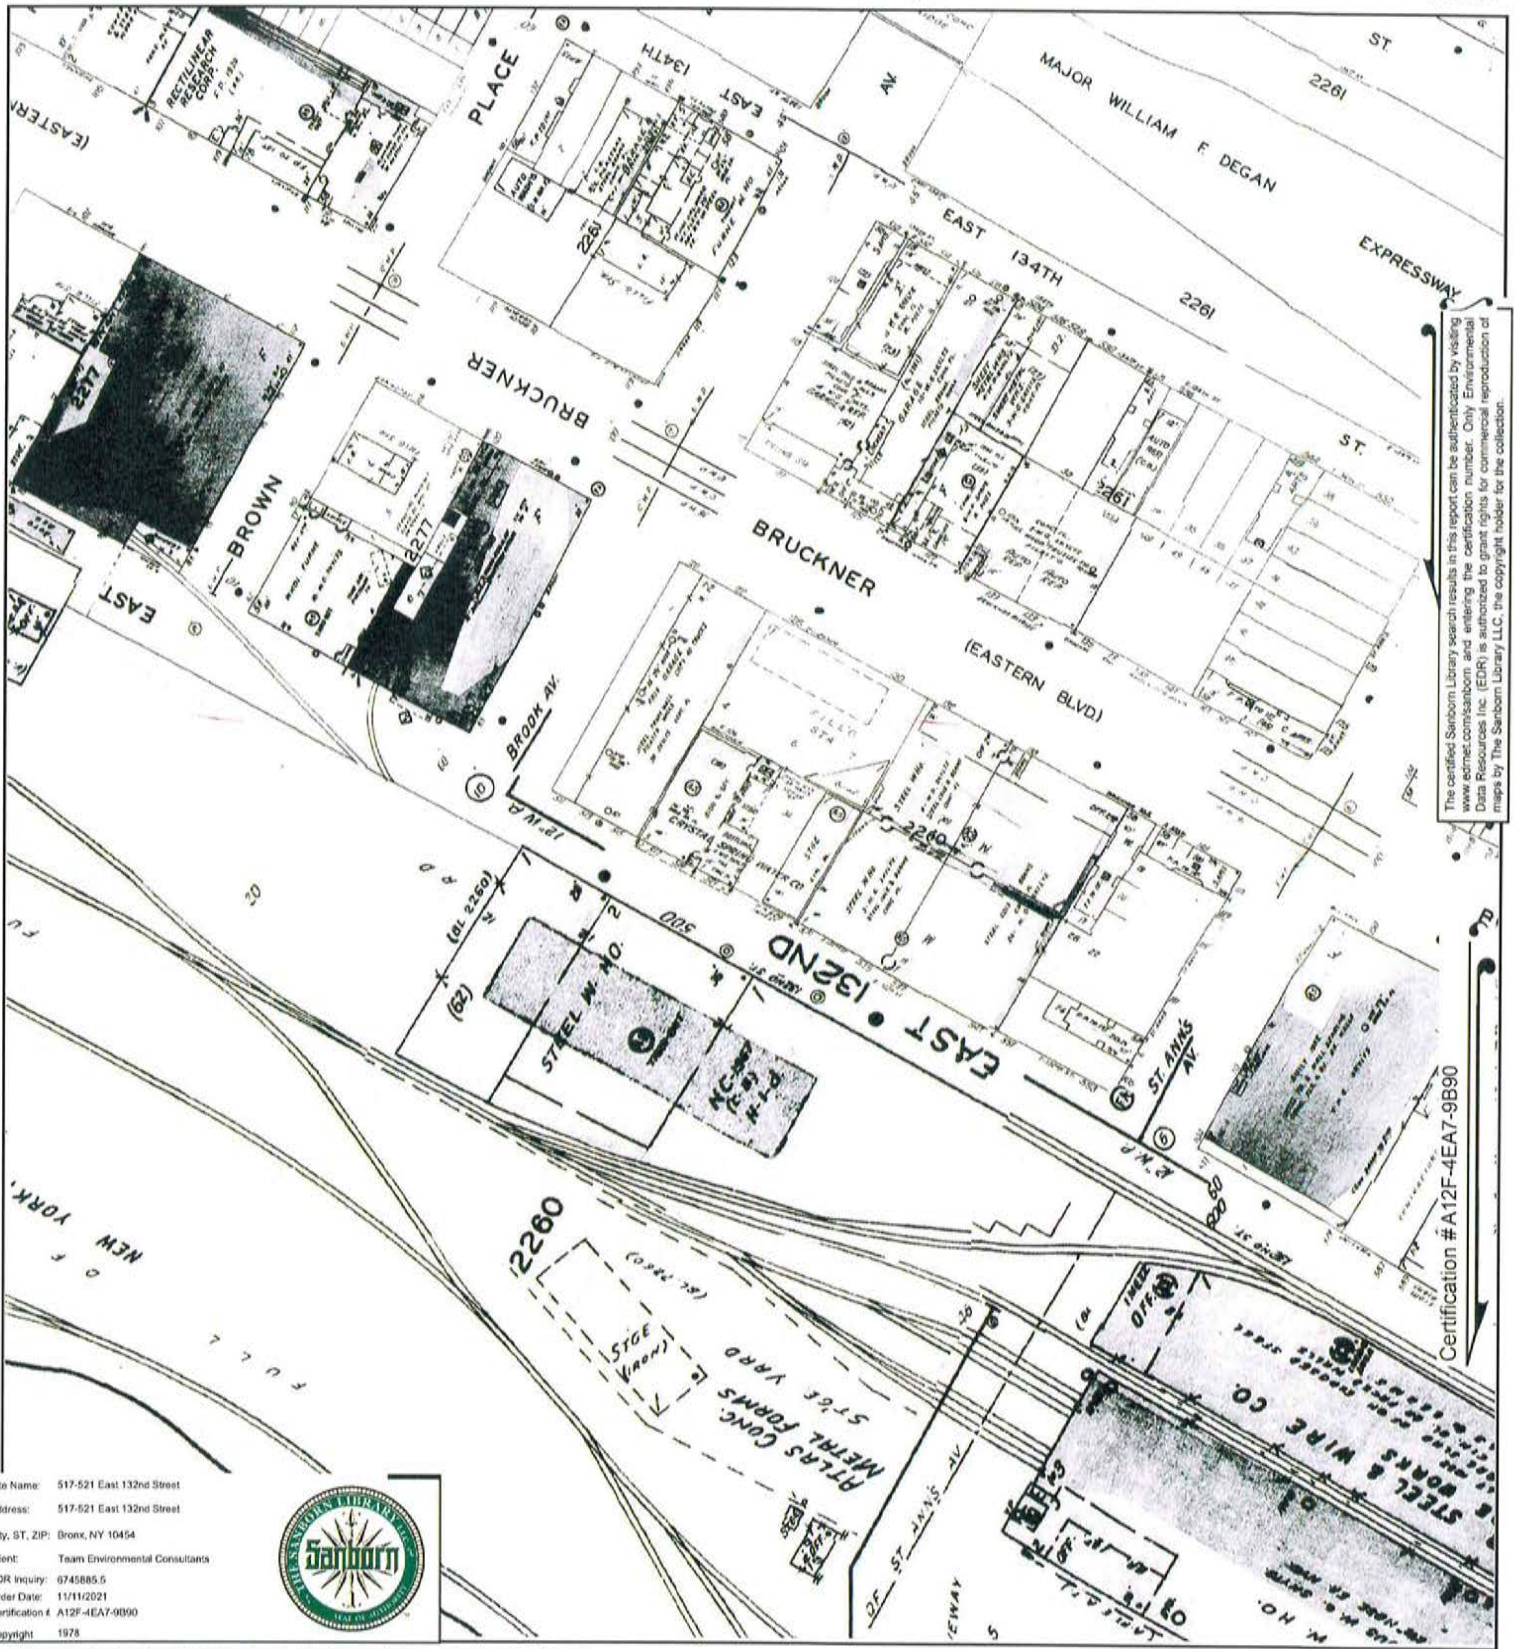




Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1978



The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.


Certification #A12F-4EA7-9B90

This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

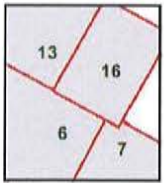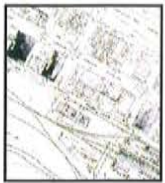

Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6



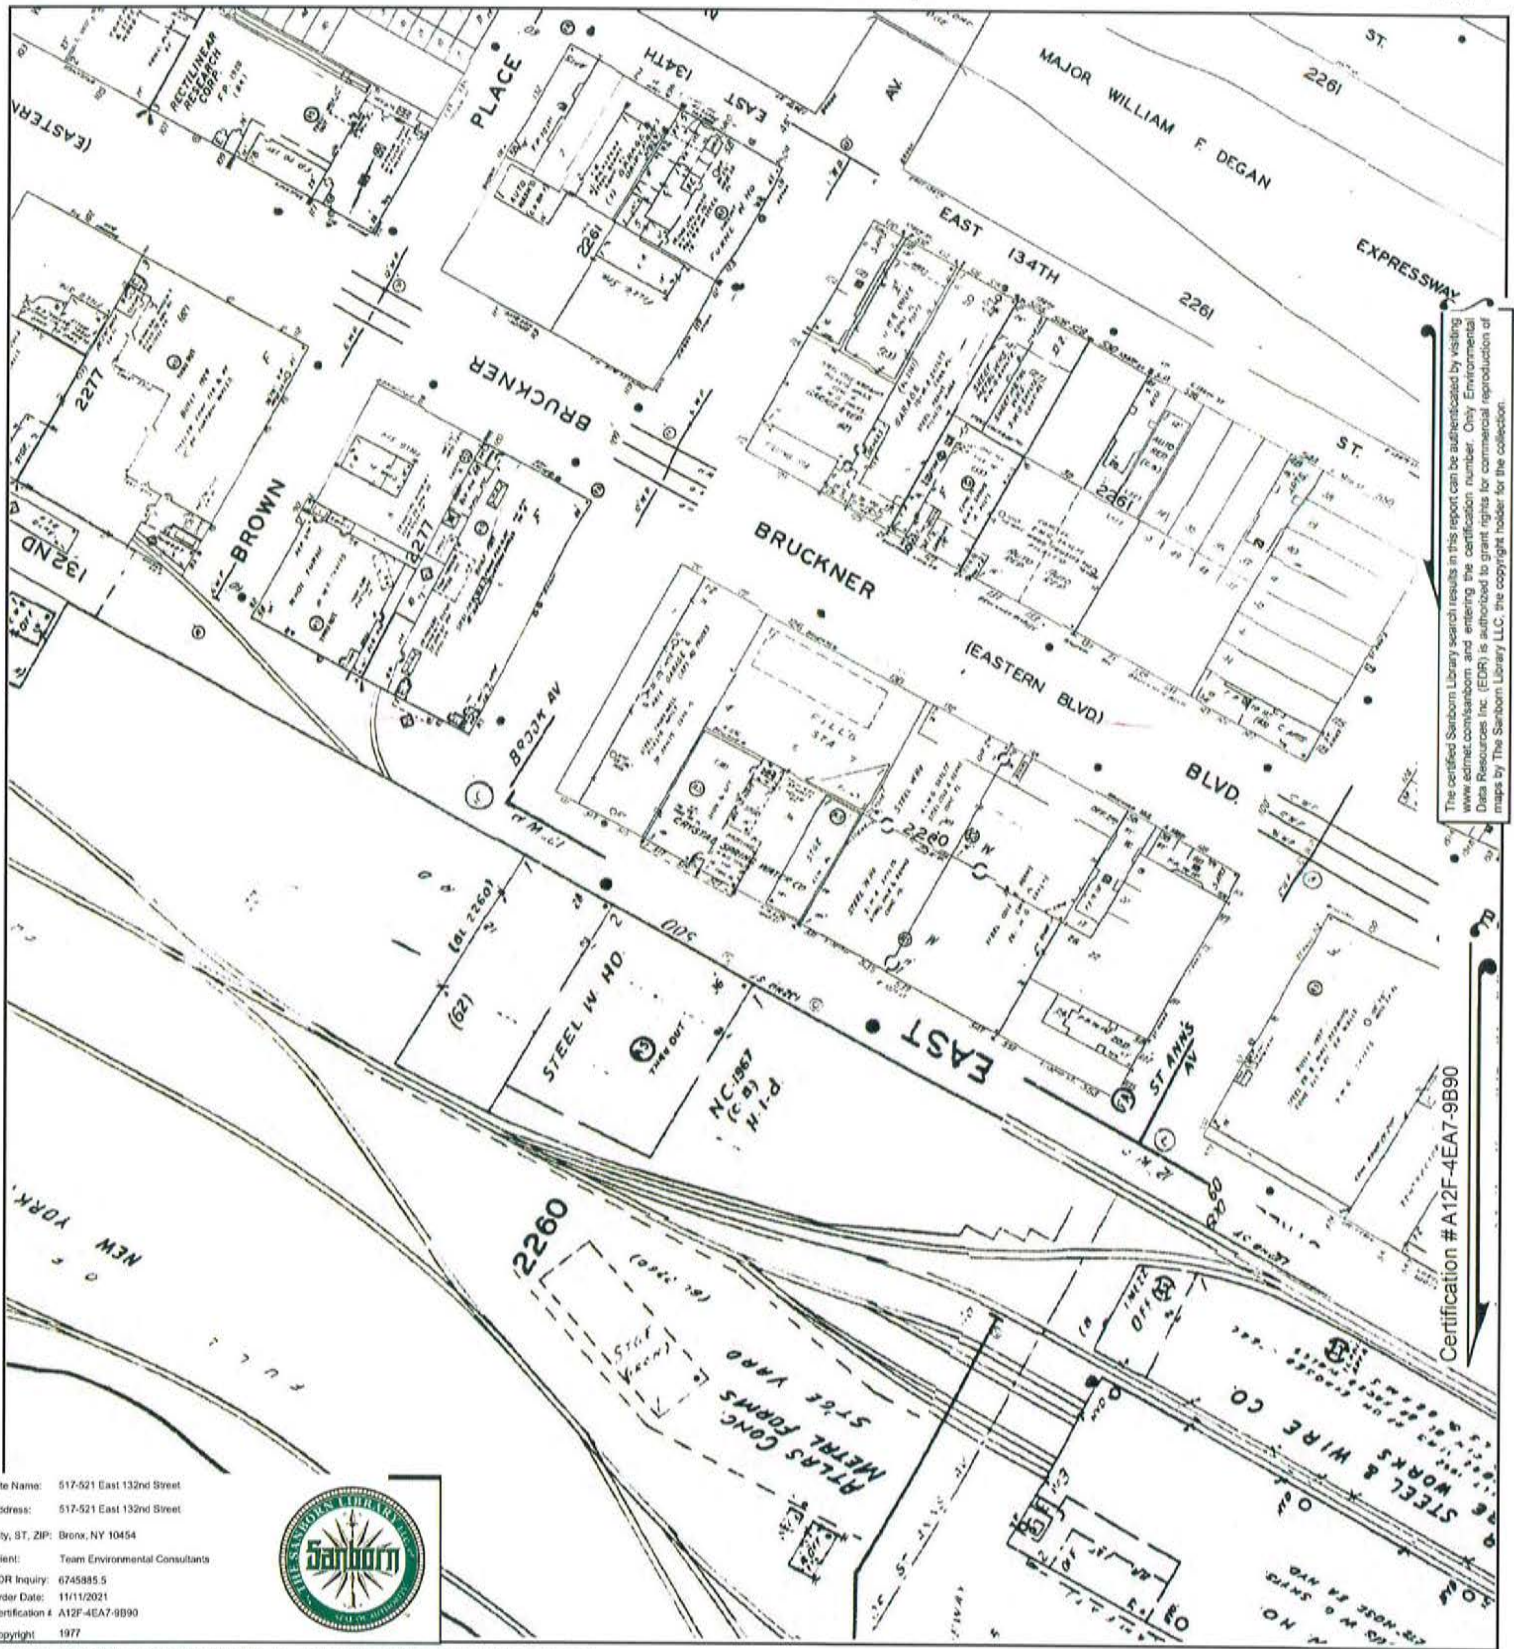



The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A12F-4EA7-9B90

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885 5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1977




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

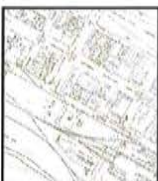

Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 6




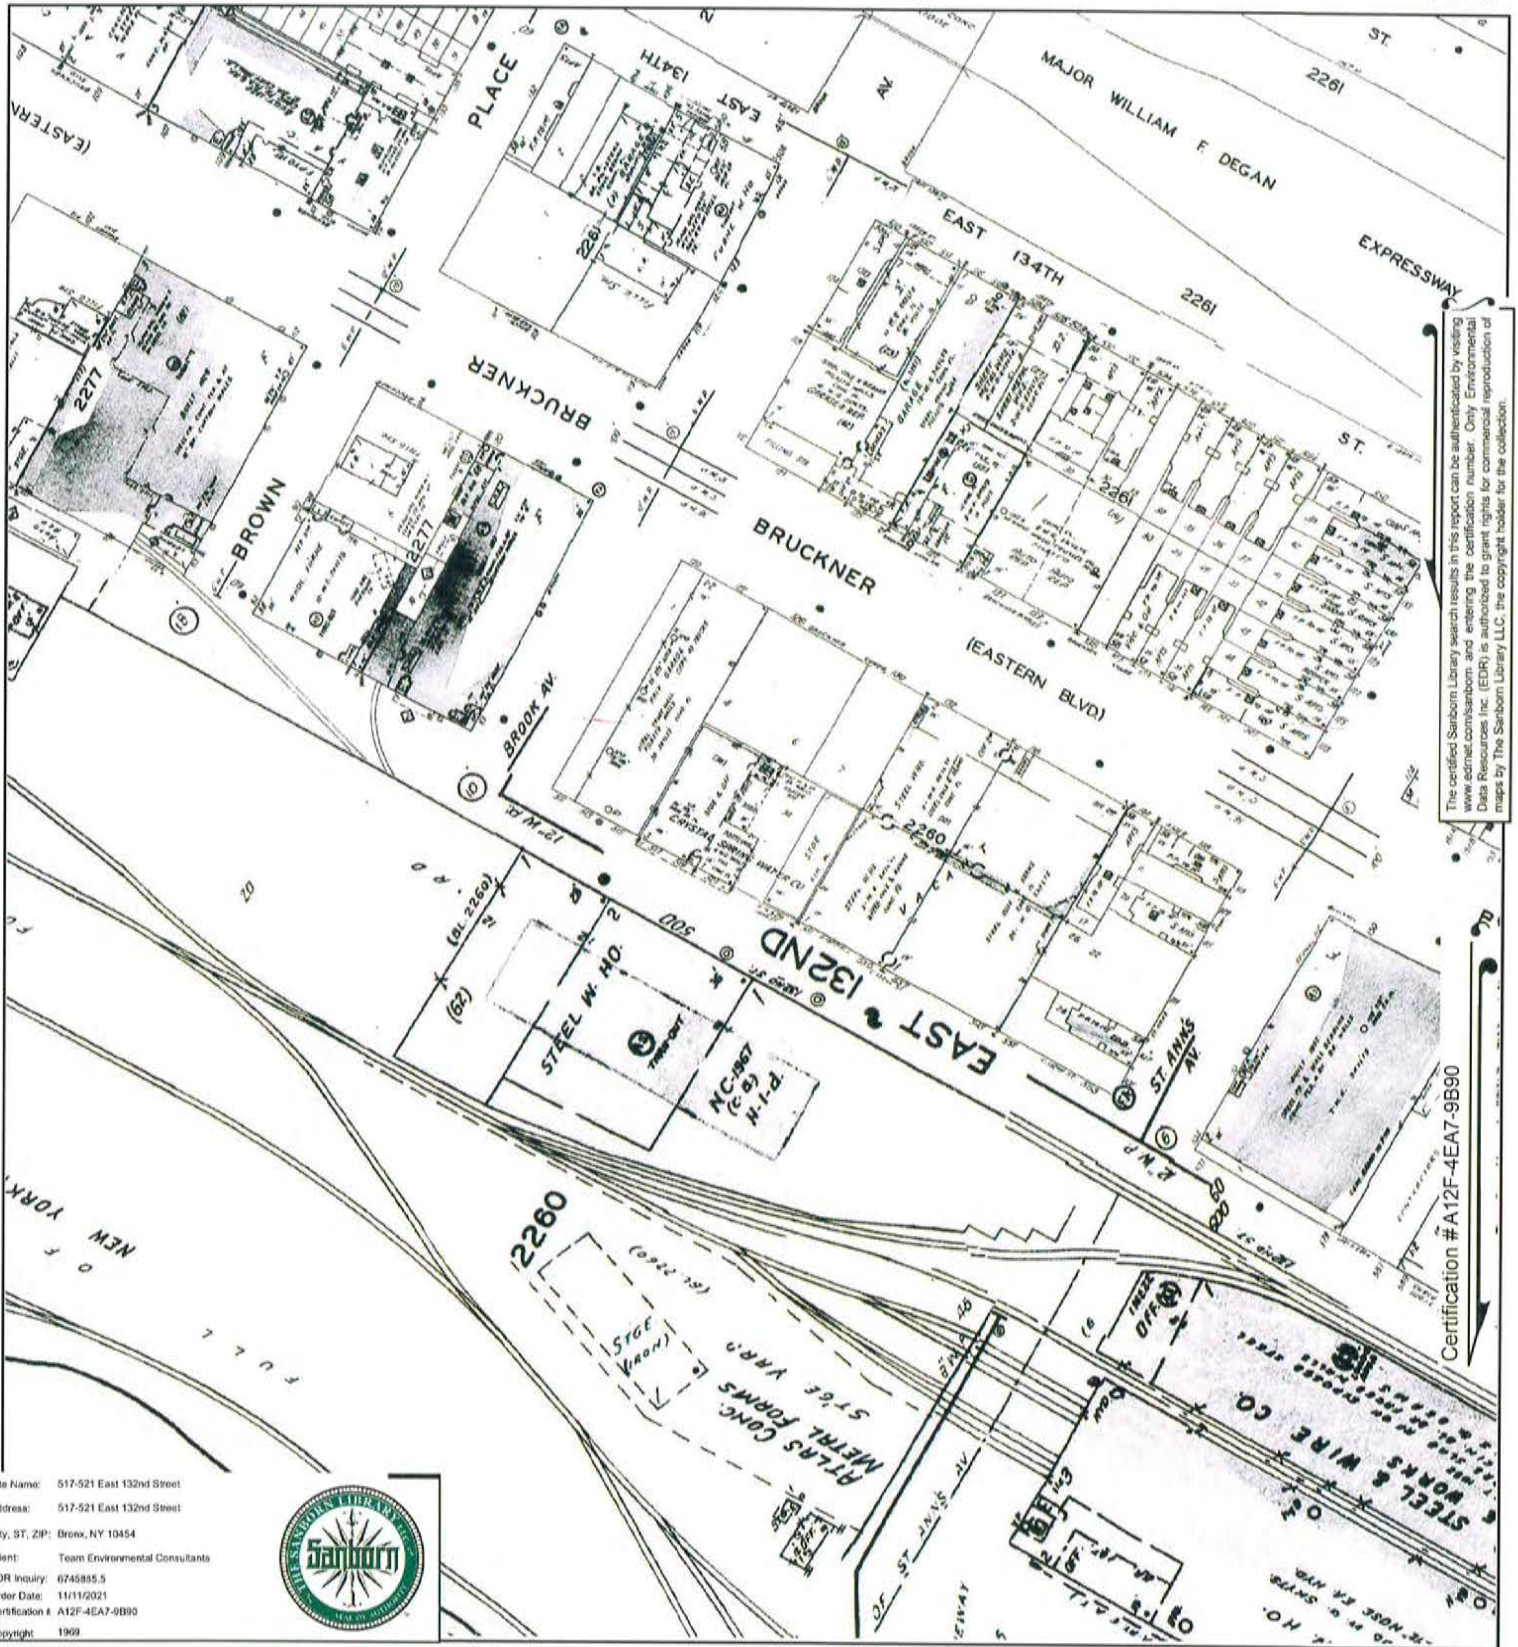

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1969




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 6

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.


Certification #A12F-4EA7-9B90

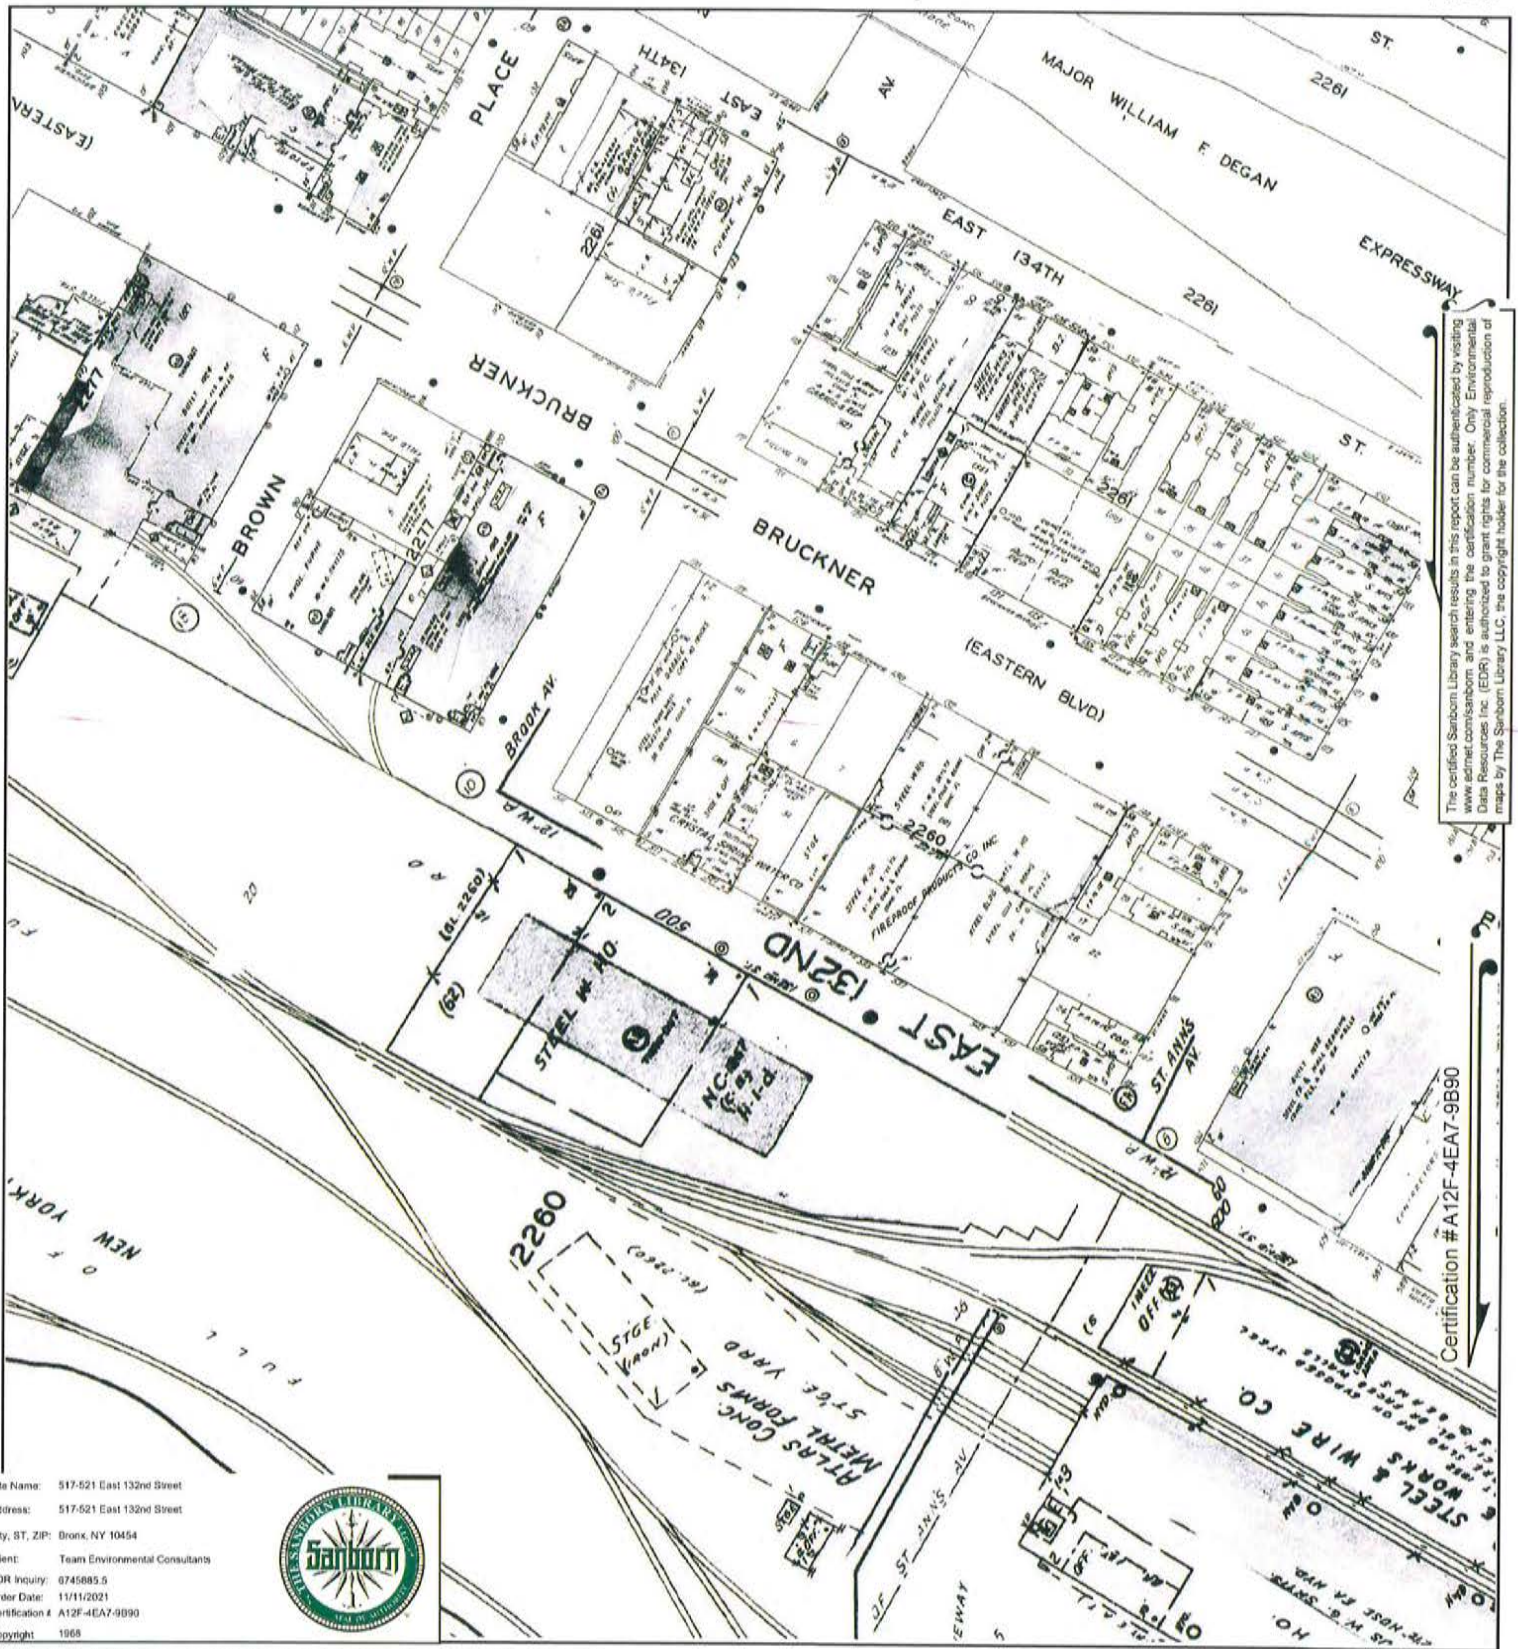


Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 0745695.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1968



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6

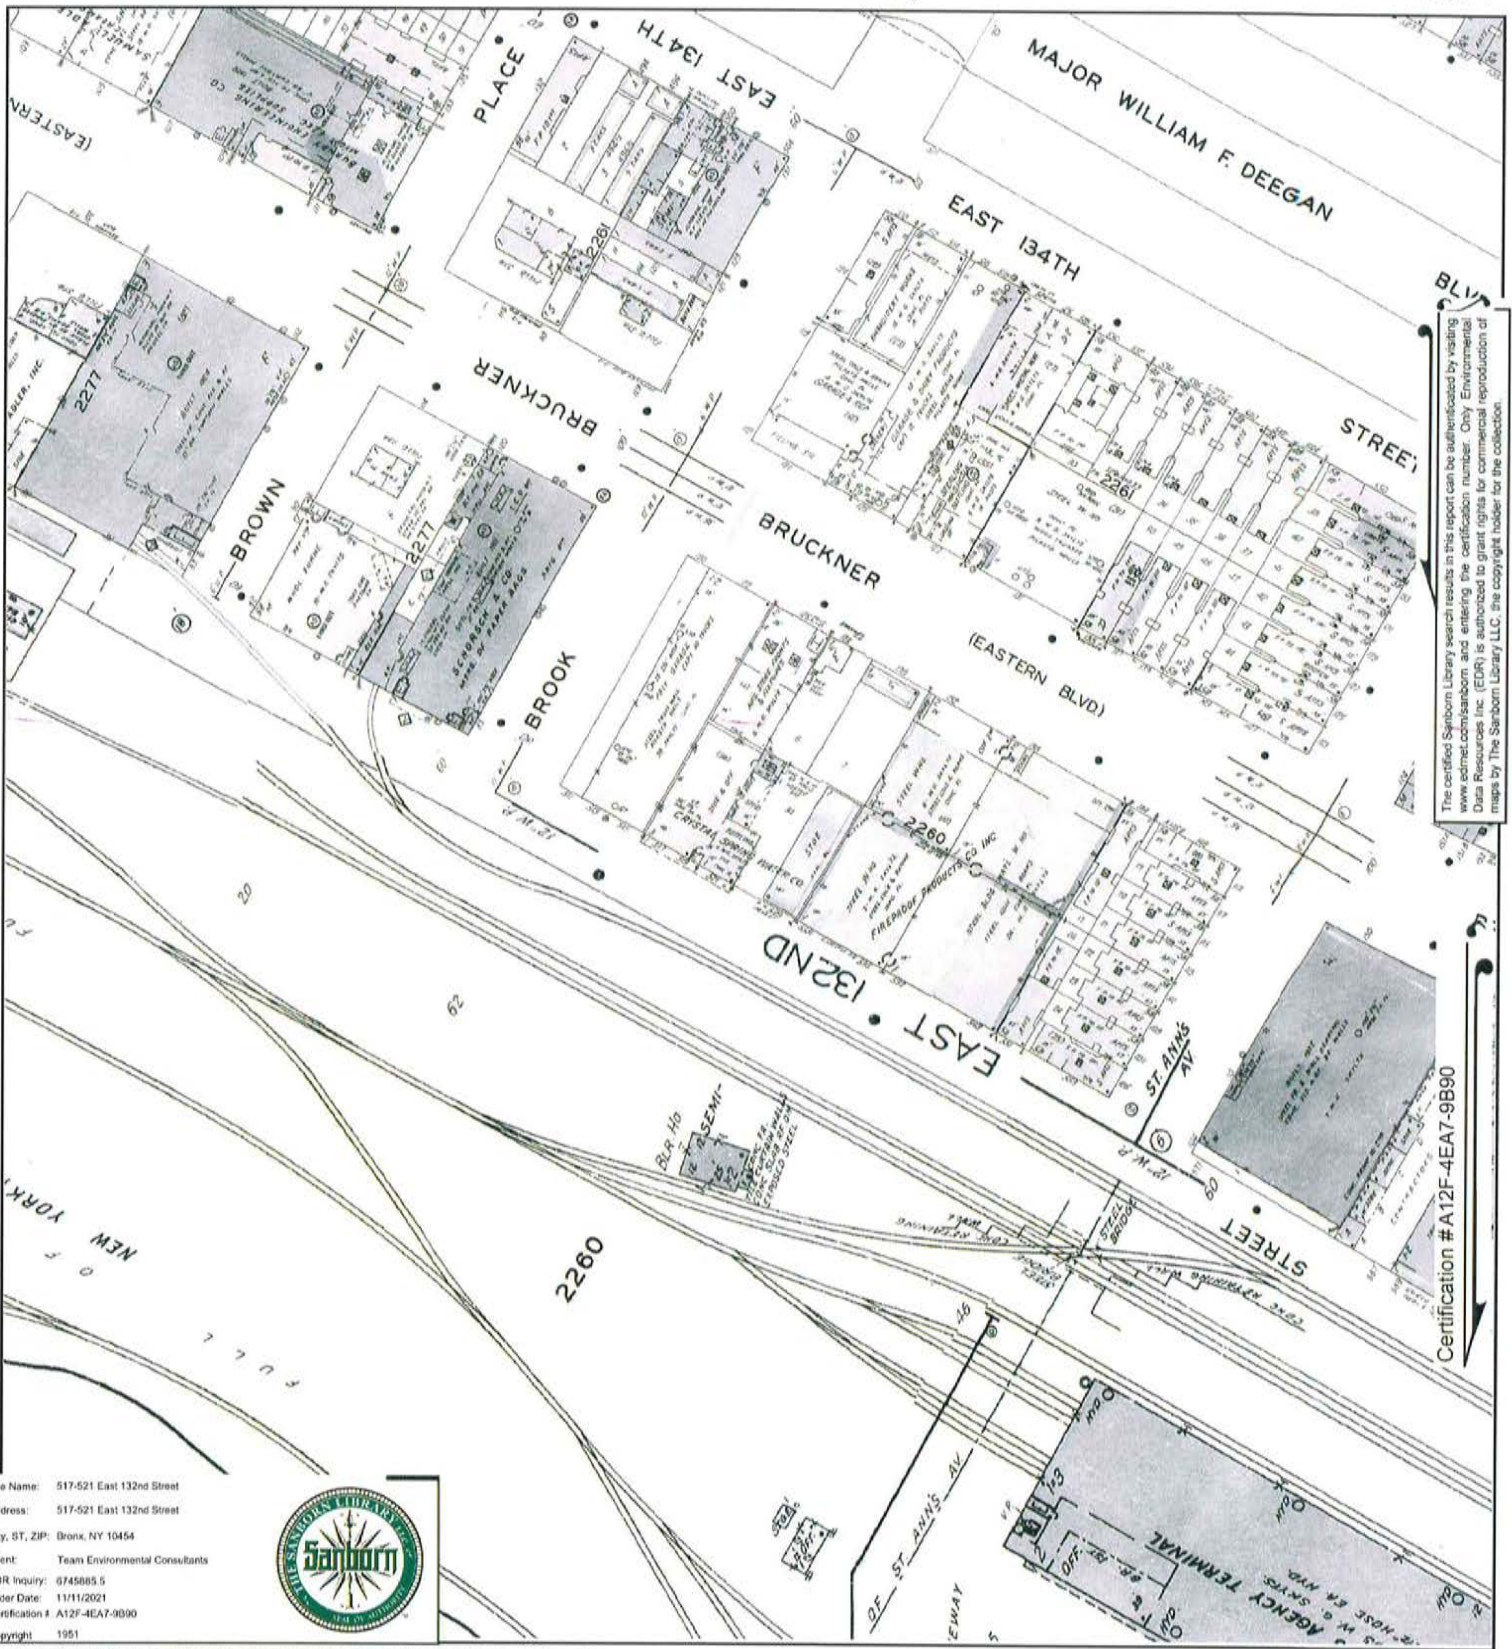

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1951



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.




Volume 9S, Sheet 16
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6
 Volume 9S, Sheet 13

0 Feet 150 300 600



The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A12F-4EA7-9B90

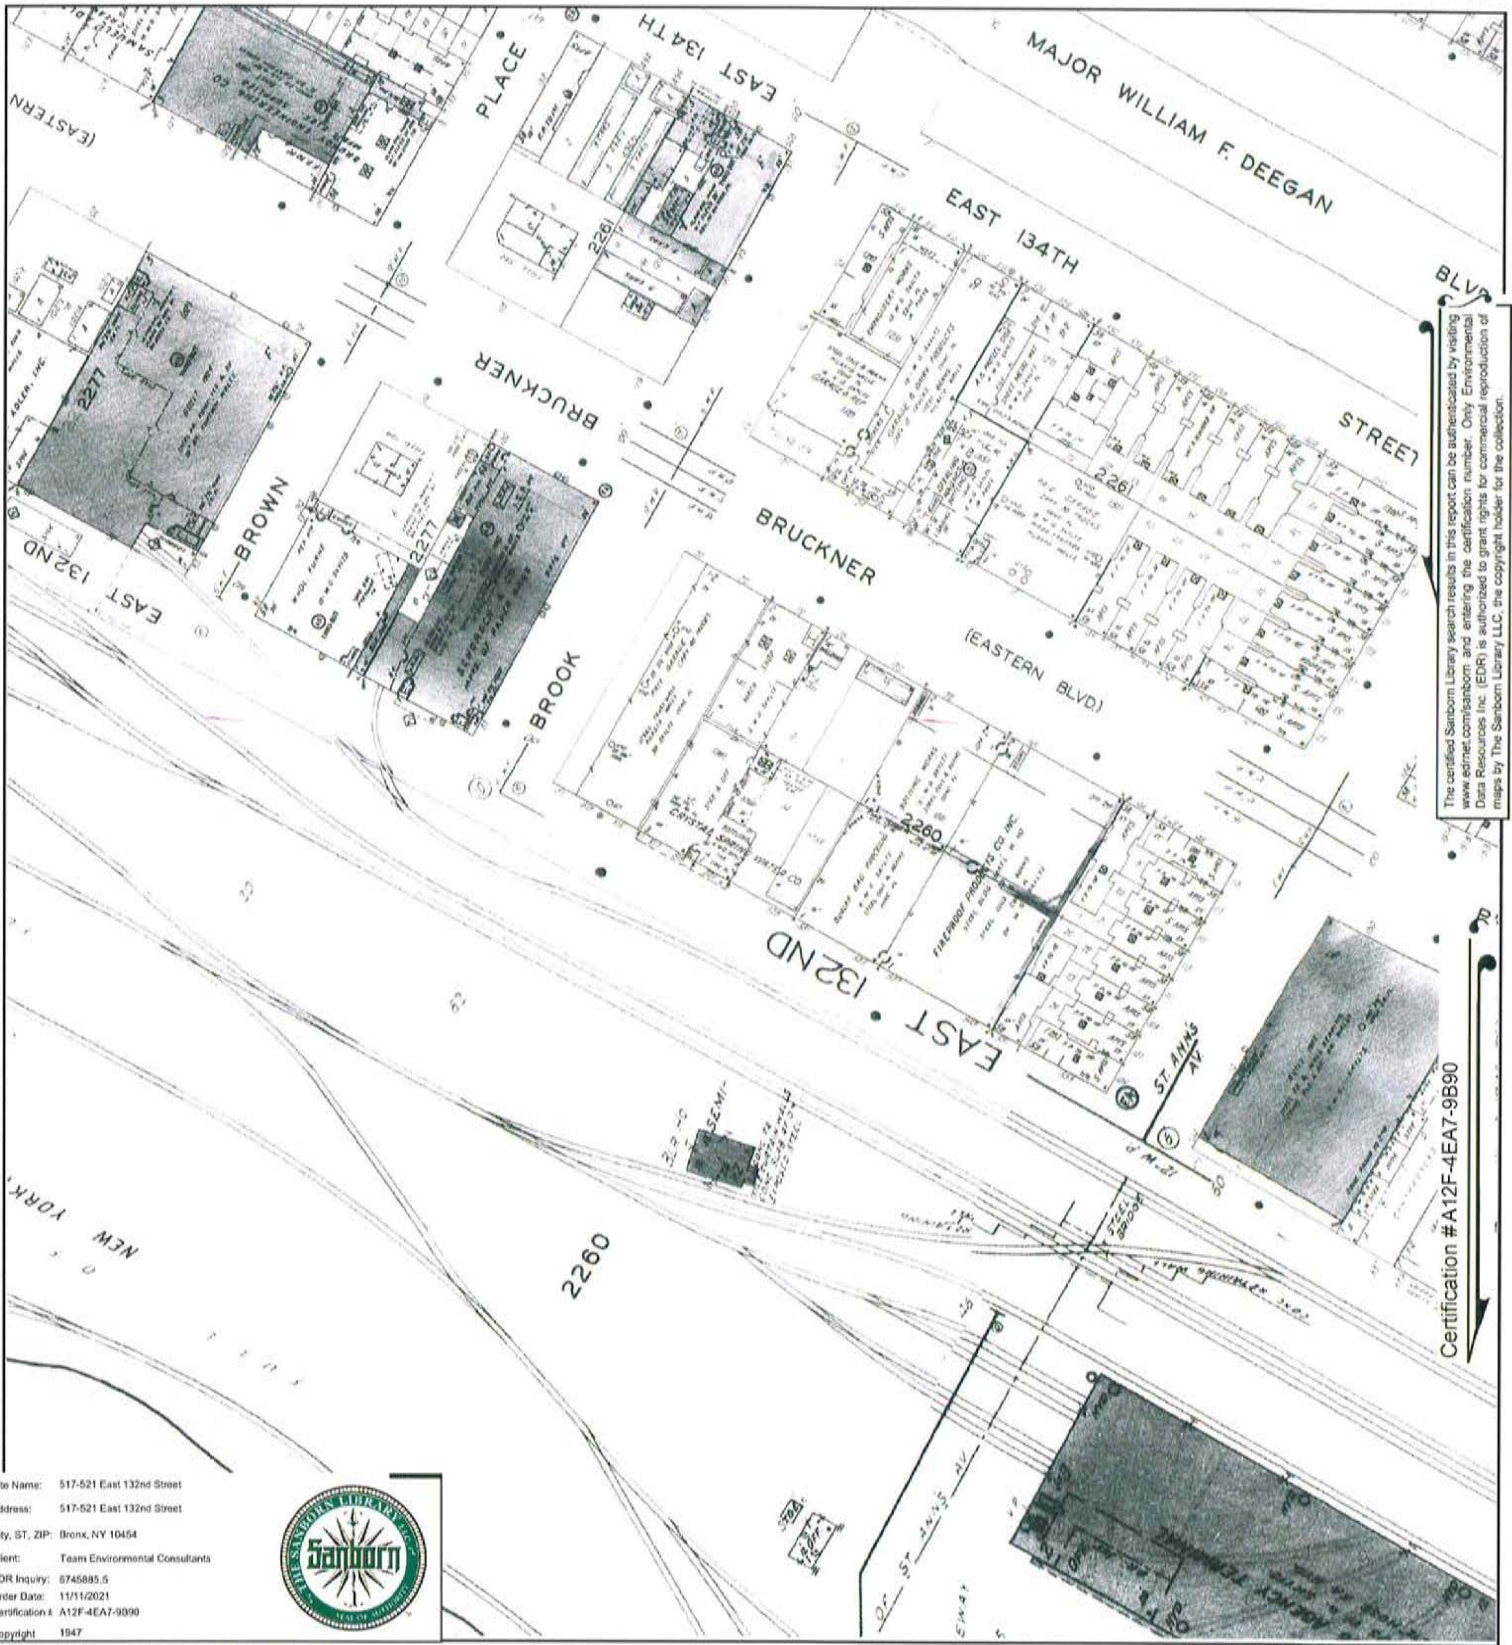


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A12F-4EA7-9B90

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification: A12F-4EA7-9B90
 Copyright: 1947





This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.




Volume 9S, Sheet 16
 Volume 9S, Sheet 13
 Volume 9S, Sheet 7
 Volume 9S, Sheet 6



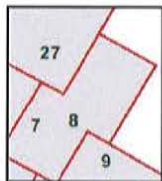


6745885 - 5 page 36

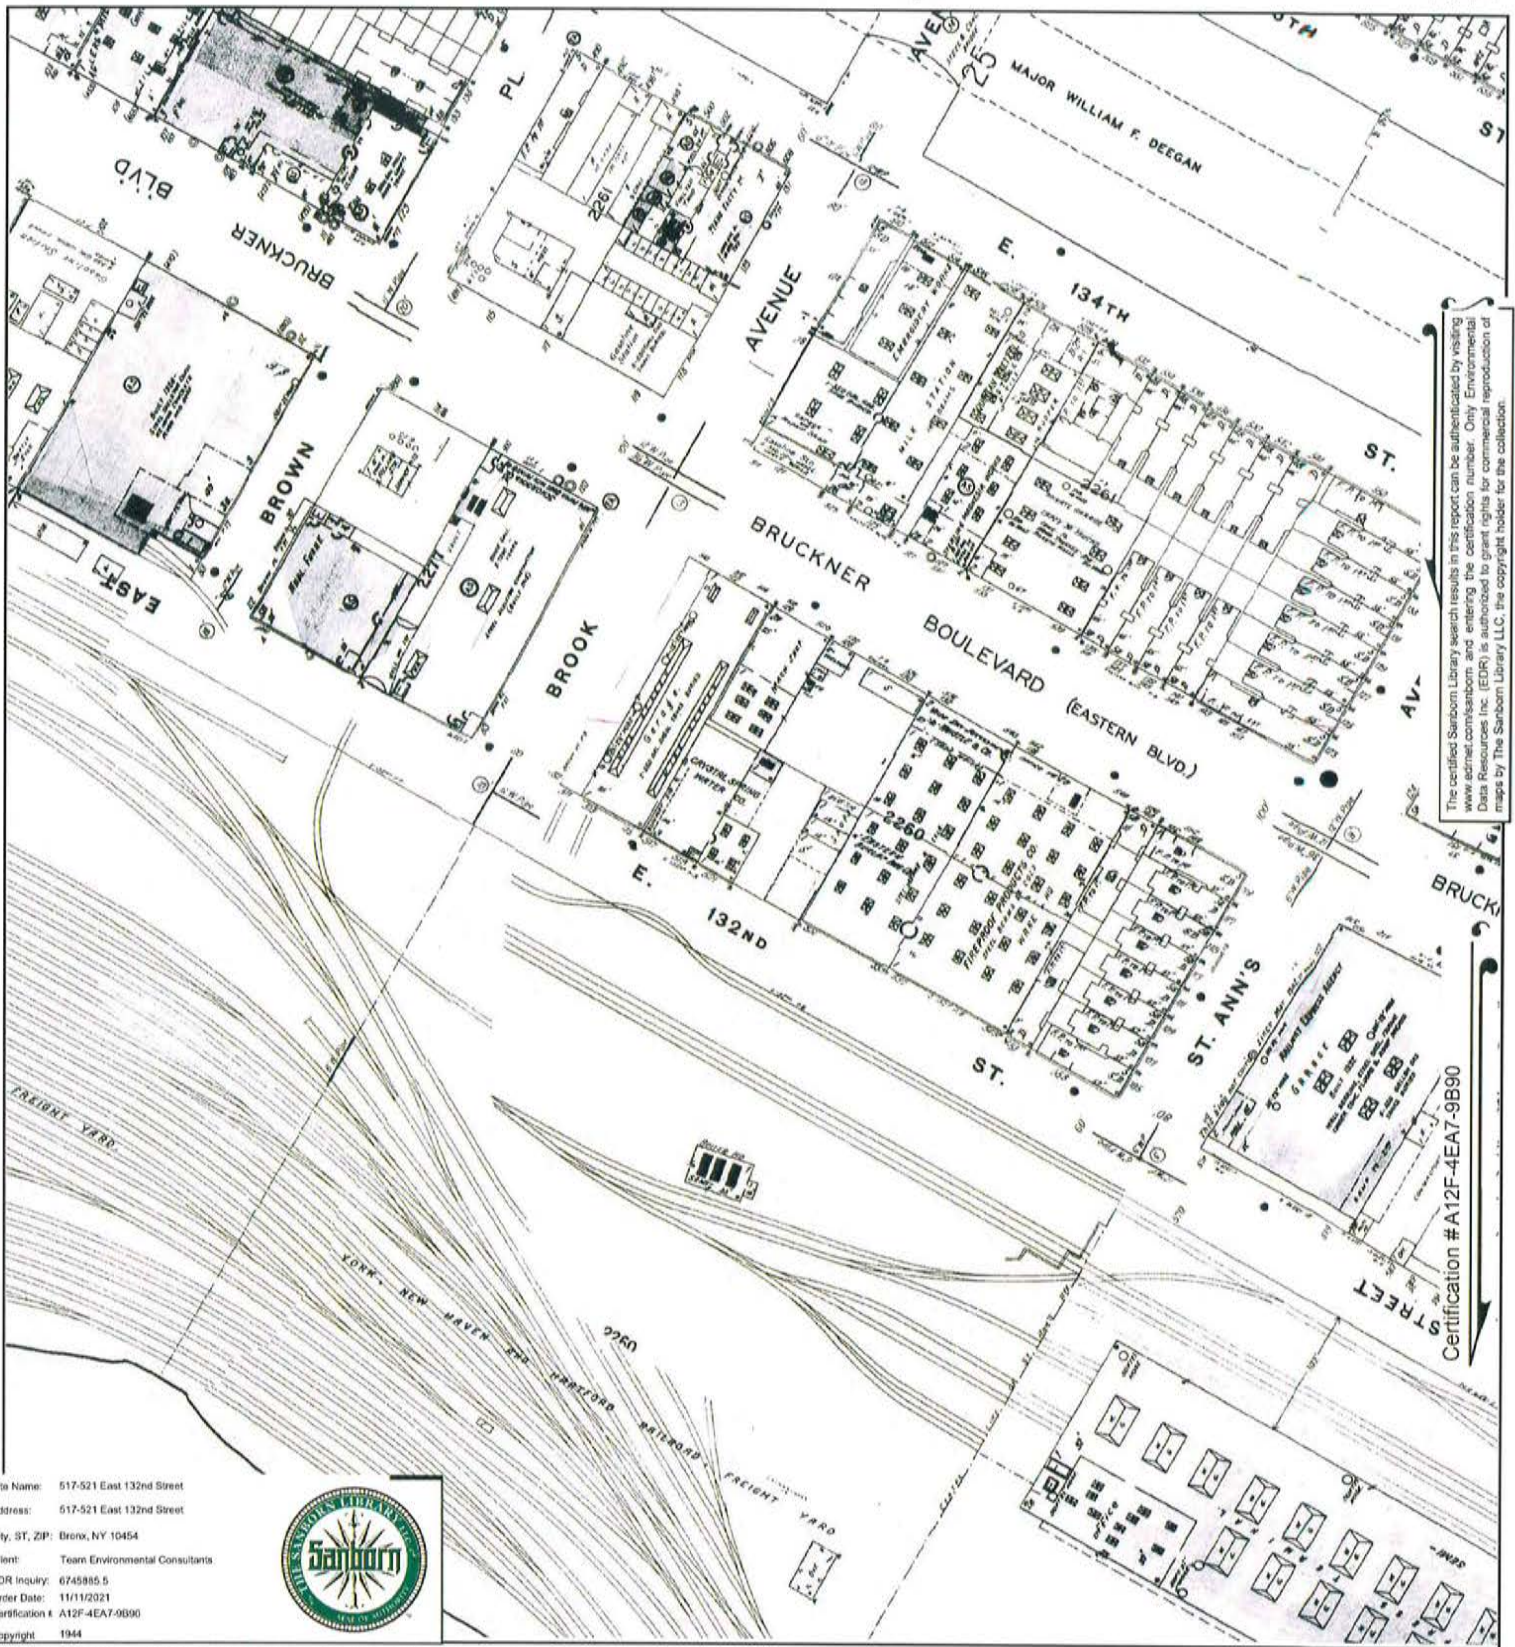


Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1944



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.




Volume 9, Sheet 27
 Volume 9, Sheet 9
 Volume 9, Sheet 8
 Volume 9, Sheet 7

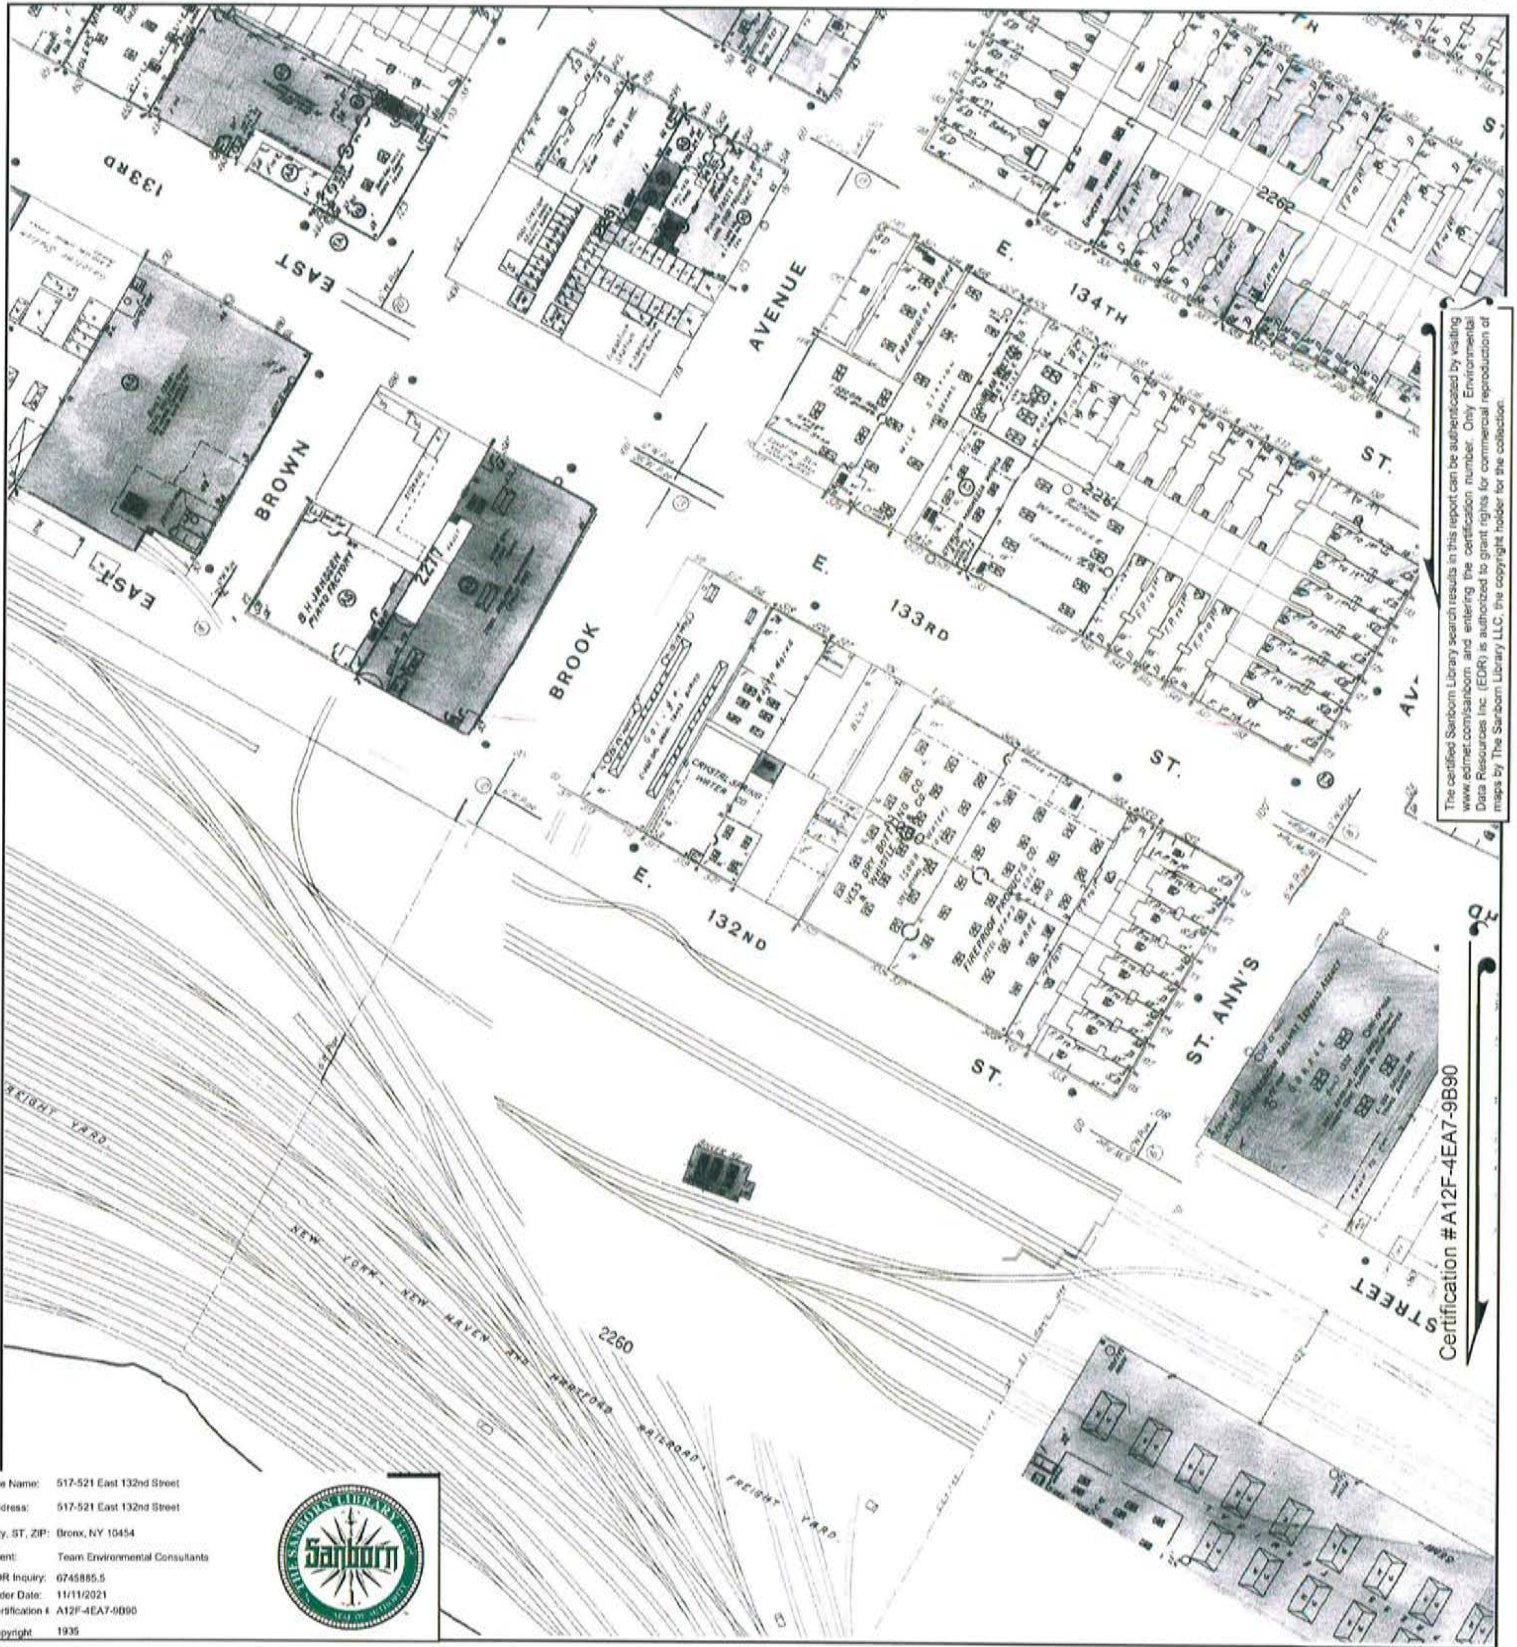


Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1935



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 9, Sheet 27
 Volume 9, Sheet 9
 Volume 9, Sheet 8
 Volume 9, Sheet 7

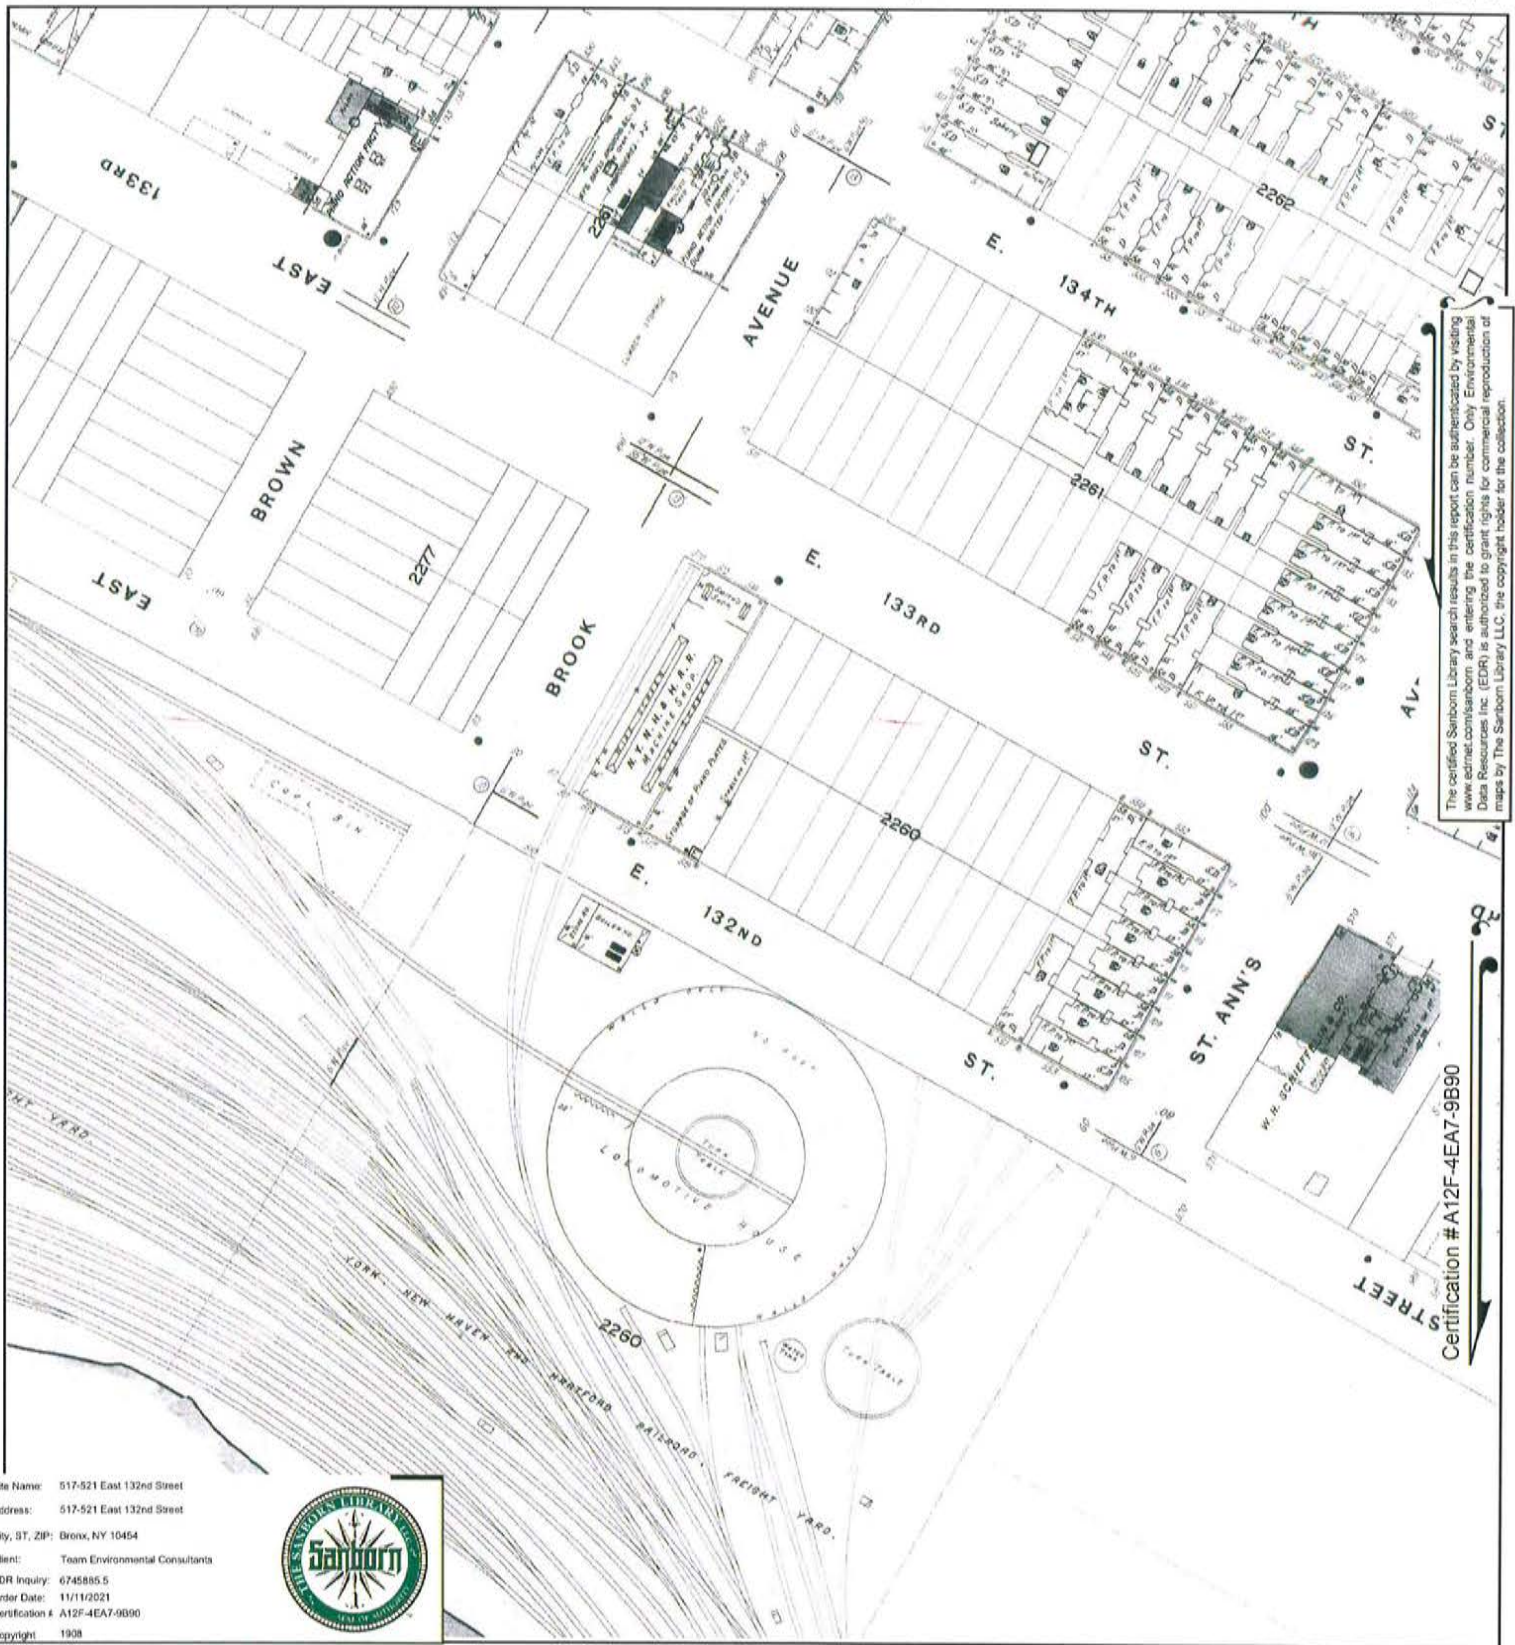


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A12F-4EA7-9B90

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1908



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 9, Sheet 27
 Volume 9, Sheet 9
 Volume 9, Sheet 8
 Volume 9, Sheet 7







The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #A12F-4EA7-9B90

Site Name: 517-521 East 132nd Street
 Address: 517-521 East 132nd Street
 City, ST, ZIP: Bronx, NY 10454
 Client: Team Environmental Consultants
 EDR Inquiry: 6745885.5
 Order Date: 11/11/2021
 Certification #: A12F-4EA7-9B90
 Copyright: 1891



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

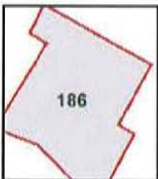

Volume 9, Sheet 186



ATTACHMENT D

PHASE I ESA INTERVIEW AND INFORMATION SOURCES

ATTACHMENT D

PHASE I ESA INTERVIEW & INFORMATION SOURCES

122 BRUCKNER DEVELOPMENT & PARTNERS LLC

517-519 EAST 132ND STREET, BRONX, NEW YORK 10454

Information Source	Affiliation	Phone Number
Matt Grabina	Altmark Group LLC	631-525-3783
Adi Altmark	Altmark Group LLC	516-351-5617
Beth Christensen	Environmental Data Resources	866-783-3702

ATTACHMENT E

FEDERAL & STATE DATABASE REPORT

517-521 East 132nd Street
517-521 East 132nd Street
Bronx, NY 10454

Inquiry Number: 06745885.2r
November 11, 2021

FirstSearch Area/Linear Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Search Summary Report

**TARGET SITE 517-521 EAST 132ND STREET
BRONX, NY 10454**

Category	Sel	Site	1/8	1/4	1/2	> 1/2	ZIP	TOTALS
<i>NPL</i>	Y	0	0	0	-	-	0	0
<i>NPL Delisted</i>	Y	0	0	0	-	-	0	0
<i>CERCLIS</i>	Y	0	0	0	-	-	0	0
<i>NFRAP</i>	Y	0	0	0	-	-	1	1
<i>RCRA COR ACT</i>	Y	0	0	0	-	-	0	0
<i>RCRA TSD</i>	Y	0	0	-	-	-	0	0
<i>RCRA GEN</i>	Y	0	5	-	-	-	0	5
<i>Federal IC / EC</i>	Y	0	0	0	-	-	0	0
<i>ERNS</i>	Y	0	-	-	-	-	0	0
<i>State/Tribal CERCLIS</i>	Y	0	0	0	-	-	0	0
<i>State/Tribal SWL</i>	Y	0	2	0	-	-	4	6
<i>State/Tribal LTANKS</i>	Y	0	5	4	-	-	0	9
<i>State/Tribal Tanks</i>	Y	2	12	1	-	-	0	15
<i>State/Tribal IC / EC</i>	Y	0	0	-	-	-	0	0
<i>State/Tribal VCP</i>	Y	0	1	2	-	-	1	4
<i>ST/Tribal Brownfields</i>	Y	0	1	0	-	-	0	1
<i>US Brownfields</i>	Y	0	0	2	-	-	0	2
<i>Other Haz Sites</i>	Y	0	-	-	-	-	0	0
<i>Other Tanks</i>	Y	0	-	-	-	-	0	0
<i>Spills</i>	Y	0	84	-	-	-	0	84
<i>Other</i>	Y	3	45	4	-	-	0	52
- Totals --		5	155	13	0	0	6	179

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2020 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Search Summary Report

**TARGET SITE: 517-521 EAST 132ND STREET
BRONX, NY 10454**

Category	Database	Update	Radius	Site	1/8	1/4	1/2	> 1/2	ZIP	TOTALS
NPL	NPL	07/29/2021	0.250	0	0	0	-	-	0	0
	Proposed NPL	07/29/2021	0.250	0	0	0	-	-	0	0
NPL Delisted	Delisted NPL	07/29/2021	0.250	0	0	0	-	-	0	0
CERCLIS	SEMS	07/29/2021	0.250	0	0	0	-	-	0	0
NFRAP	SEMS-ARCHIVE	07/29/2021	0.250	0	0	0	-	-	1	1
RCRA COR ACT	CORRACTS	09/13/2021	0.250	0	0	0	-	-	0	0
RCRA TSD	RCRA-TSDF	09/13/2021	0.125	0	0	-	-	-	0	0
RCRA GEN	RCRA-LQG	09/13/2021	0.125	0	3	-	-	-	0	3
	RCRA-SQG	09/13/2021	0.125	0	0	-	-	-	0	0
	RCRA-VSQG	09/13/2021	0.125	0	2	-	-	-	0	2
Federal IC / EC	US ENG CONTROLS	05/17/2021	0.250	0	0	0	-	-	0	0
	US INST CONTROLS	05/17/2021	0.250	0	0	0	-	-	0	0
ERNS	ERNS	06/14/2021	TP	0	-	-	-	-	0	0
State/Tribal CERCLIS	SHWS	08/09/2021	0.250	0	0	0	-	-	0	0
State/Tribal SWL	SWF/LF	03/31/2021	0.250	0	2	0	-	-	4	6
State/Tribal LTANKS	INDIAN LUST	04/28/2021	TP	0	-	-	-	-	0	0
	LTANKS	08/09/2021	0.250	0	5	4	-	-	0	9
	HIST LTANKS	01/01/2002	TP	0	-	-	-	-	0	0
State/Tribal Tanks	UST	06/21/2021	0.125	2	12	-	-	-	0	14
	CBS UST	01/01/2002	0.250	0	0	0	-	-	0	0
	MOSF UST	01/01/2002	0.250	0	0	0	-	-	0	0
	MOSF	06/21/2021	0.250	0	0	0	-	-	0	0
	CBS	06/21/2021	0.250	0	0	1	-	-	0	1
	AST	06/21/2021	TP	0	-	-	-	-	0	0
	CBS AST	01/01/2002	0.250	0	0	0	-	-	0	0
	MOSF AST	01/01/2002	0.250	0	0	0	-	-	0	0
	INDIAN UST	04/28/2021	TP	0	-	-	-	-	0	0
	TANKS	06/21/2021	TP	0	-	-	-	-	0	0

Search Summary Report

**TARGET SITE: 517-521 EAST 132ND STREET
BRONX, NY 10454**

Category	Database	Update	Radius	Site	1/8	1/4	1/2	> 1/2	ZIP	TOTALS
State/Tribal IC / EC	RES DECL	05/12/2021	0.125	0	0	-	-	-	0	0
	ENG CONTROLS	08/09/2021	0.250	0	0	0	-	-	0	0
	INST CONTROL	08/09/2021	0.250	0	0	0	-	-	0	0
State/Tribal VCP	VCP	08/09/2021	0.250	0	1	2	-	-	1	4
ST/Tribal Brownfields	BROWNFIELDS	08/09/2021	0.250	0	1	0	-	-	0	1
	ERP	08/09/2021	0.250	0	0	0	-	-	0	0
US Brownfields	US BROWNFIELDS	06/10/2021	0.250	0	0	2	-	-	0	2
Other Haz Sites	US CDL	05/18/2021	TP	0	-	-	-	-	0	0
Other Tanks	HIST UST	01/01/2002	TP	0	-	-	-	-	0	0
	HIST AST	01/01/2002	TP	0	-	-	-	-	0	0
Spills	HMIRS	09/12/2021	TP	0	-	-	-	-	0	0
	NY Spills	08/09/2021	0.125	0	84	-	-	-	0	84
	NY Hist Spills	01/01/2002	TP	0	-	-	-	-	0	0
	SPILLS 90	12/14/2012	TP	0	-	-	-	-	0	0
	SPILLS 80	11/02/2010	TP	0	-	-	-	-	0	0
Other	RCRA NonGen / NLR	09/13/2021	0.125	0	45	-	-	-	0	45
	TSCA	12/31/2016	TP	0	-	-	-	-	0	0
	TRIS	12/31/2018	TP	0	-	-	-	-	0	0
	SSTS	07/19/2021	TP	0	-	-	-	-	0	0
	RAATS	04/17/1995	TP	0	-	-	-	-	0	0
	PRP	12/30/2020	TP	0	-	-	-	-	0	0
	PADS	11/19/2020	TP	0	-	-	-	-	0	0
	ICIS	11/18/2016	TP	1	-	-	-	-	0	1
	FTTS	04/09/2009	TP	0	-	-	-	-	0	0
	MLTS	03/08/2021	TP	0	-	-	-	-	0	0
	RADINFO	07/01/2019	TP	0	-	-	-	-	0	0
	INDIAN RESERV	12/31/2014	0.250	0	0	0	-	-	0	0
	US AIRS	10/12/2016	TP	0	-	-	-	-	0	0
	FINDS	05/05/2021	TP	2	-	-	-	-	0	2
	DRYCLEANERS	06/03/2021	0.125	0	0	-	-	-	0	0
	HSWDS	01/01/2003	0.250	0	0	0	-	-	0	0
	MANIFEST	01/01/2019	TP	0	-	-	-	-	0	0
	SPDES	07/27/2021	0.250	0	0	4	-	-	0	4
	- Totals --			5	155	13	0	0	6	179

Site Information Report

Request Date: NOVEMBER 11, 2021
Request Name: MARTIN WODKA

Search Type: COORD
Job Number: NA

Target Site: 517-521 EAST 132ND STREET
BRONX, NY 10454

Site Location

	<u>Degrees (Decimal)</u>	<u>Degrees (Min/Sec)</u>	<u>UTMs</u>
Longitude:	73.921395	73.9213950 - 73° 55' 17.02"	Easting: 590984.2
Latitude:	40.803656	40.8036560 - 40° 48' 13.16"	Northing: 4517309.5
Elevation:	19 ft. above sea level		Zone: Zone 18

Demographics

Sites: 173 **Non-Geocoded:** 6 **Population:** N/A
RADON

Federal EPA Radon Zone for BRONX County: 3

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for BRONX COUNTY, NY

Number of sites tested: 31

<u>Area</u>	<u>Average Activity</u>	<u>% <4 pCi/L</u>	<u>% 4-20 pCi/L</u>	<u>% >20 pCi/L</u>
Living Area	0.670 pCi/L	96%	4%	0%
Basement	1.110 pCi/L	42%	58%	0%

Target Site Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
A1	UST	220 EAST REALTY LLC	517 EAST 132ND STREET BRONX, NY 10454	0.00	+ 0	1
A2	FINDS --110070275655	SPARKZ IRON WORKS CORP.	519 EAST 132 STREET BRONX, NY 10454	0.00	+ 0	5
A3	UST	220 EAST REALTY INC.	511-517 EAST 132 STREET BRONX, NY 10454	0.00	+ 0	6
A4	FINDS --110066856502	BRIGHT LIGHT CONSTRUCTION LLC.	517 EAST 132ND STREET, 1S BRONX, NY 10454	0.00	+ 0	12
A4	ICIS --110066856502	BRIGHT LIGHT CONSTRUCTION LLC.	517 EAST 132ND STREET, 1S BRONX, NY 10454	0.00	+ 0	13

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
A5	UST	MOBIL S/S 1JARDH AAMCO TRANAS	MOBIL S/S 1JARDH AAMCO TR BRONX, NY 10400	0.01 North	- 1	14
A6	NY Spills --8606553 / 1987-10-23 --208428 --1987-01-22	126 BRUCKNER BLVD.BRONX /	126 BRUCKNER BLVD. BRONX, NY	0.01 NE	- 1	17
A7	NY Spills --9405017 / 2016-03-24 --68189 --1994-07-12	HESS STATION 32506	126-128 BRUCKNER BLVD BRONX, NY	0.01 NE	- 1	19
A7	LTANKS --9205097 / 1994-07-22 --237445 --1992-07-30	HESS STATION 32506	126-128 BRUCKNER BLVD BRONX, NY	0.01 NE	- 1	25
A8	NY Spills --1902733 / 2019-06-17 --590668 --2019-06-17	SPEEDWAY 7811	126 BRUCKNER BLVD BRONX, NY 10454	0.01 NE	- 1	27
A8	UST	SPEEDWAY 7811	126 BRUCKNER BLVD BRONX, NY 10454	0.01 NE	- 1	29
A8	RCRA-VSQG --NYD982185605	SPEEDWAY 7811	126 BRUCKNER BLVD BRONX, NY 10454	0.01 NE	- 1	68
9	NY Spills --9906764 / 1999-12-14 --131518 --1999-09-07	MANHOLE 5962	IFO 550 E 132ND ST BRONX, NY	0.02 South	+ 0	74
B10	NY Spills --9902868 / 2003-06-25 --212693 --1999-06-12	MANHOLE 6017	BROOKE AVE/E 132 ST BRONX, NY	0.02 West	+ 0	76
C11	BROWNFIELDS --595017	138 BRUCKNER BOULEVARD	138 BRUCKNER BOULEVARD / BRONX, NY 10454	0.02 East	- 1	78
C12	NY Spills --9804809 / 2003-11-17 --322371 --1998-07-17	ZARO BAKE SHOP INC	138 BRUCKNER BOULEVARD BRONX, NY 10454	0.02 East	- 1	81

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
C12	UST	ZARO BAKE SHOP INC	138 BRUCKNER BOULEVARD BRONX, NY 10454	0.02 East	- 1	83
B13	RCRA NonGen / NLR CON EDISON --NYP004751616		BROOK AVE & 132ND ST BRONX, NY 10454	0.02 West	+ 0	86
B14	NY Spills --1702982 / 2017-06-26 --553135 --2017-06-26	IN CONTAINMENT	BROOK AVE AND 132ND BRONX, NY	0.02 West	+ 0	90
B15	RCRA NonGen / NLR CON EDISON MANHOLE 6016 --NYP004139176		BROOK AVE & E 132 ST BRONX, NY 10453	0.02 West	+ 0	92
B16	NY Spills --9903621 / 2002-04-15 --267145 --1999-06-29	MANHOLE 6071	BROOK AVE & EAST 132ND ST BRONX, NY	0.02 West	+ 0	96
B17	RCRA NonGen / NLR CON EDISON --NYP004767927		E 132ND ST & BROOK AVE BRONX, NY 10454	0.02 West	+ 0	98
B18	RCRA NonGen / NLR CON EDISON --NYP004767935		E 132ND ST & BROOK AVE BRONX, NY 10454	0.02 West	+ 0	101
B19	RCRA NonGen / NLR CON EDISON --NYP004767919		E 132ND ST & BROOK AVE BRONX, NY 10454	0.02 West	+ 0	104
B20	NY Spills --9906759 / 1999-11-09 --75228 --1999-09-07	MANHOLE 6017	132ND ST & BROOK AVE BRONX, NY	0.02 West	+ 0	107
B21	NY Spills --1701616 / 2017-05-19 --548688 --2017-05-19	PAVEMENT	BROOK AVE AND EAST 132ND BRONX, NY	0.02 West	+ 0	109
D22	NY Spills --9809257 / 2002-10-31 --325044 --1998-10-24	IN MANHOLE 23757	E 132 ST/UNDER THE KILLS BRONX, NY	0.03 North	- 1	111

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
B23	NY Spills --0101831 / 2015-10-07 --231212 --2001-05-17	FMR. GASSMAN FUEL CO.	511 E 132ND ST BRONX, NY	0.03 WNW	+ 0	113
D24	NY Spills --0712601 / 2008-03-03 --394241 --2008-03-01	BRUCKNER BD/BROOK AVE	BRUCKNER BD/BROOK AVE BRONX, NY	0.03 North	- 1	120
D25	NY Spills --0401956 / 2004-09-09 --9900323 / 1999-04-20 --127047 --127048 --2004-05-21 --1999-04-08 *Additional key fields are available in the Map Findings section	MANHOLE 21958	BRUCKNER BLVD/BROOK AVE BRONX, NY	0.03 North	- 1	122
D26	NY Spills --0413046 / 2005-12-28 --338685 --2005-03-15	MANHOLE#21948(FRONT OF)	BRUCKNER/BROOK AVE BRONX, NY	0.03 North	- 1	126
D27	NY Spills --9901997 / 1999-07-20 --127049 --1999-05-21	MH 21948	BRUCKNER BLVD/BROOK AVE BRONX, NY	0.03 North	- 1	128
D28	NY Spills --9902874 / 2002-04-15 --259597 --1999-06-12	MANHOLE 1636	BROOK AVE/BRUCKNER BLVD BRONX, NY	0.03 North	- 1	130
D29	NY Spills --0413054 / 2005-03-16 --338695 --2005-03-15	MAHNHOLE # 21948	BRUCKNER/BROOK AVE BRONX, NY	0.03 North	- 1	133
D30	NY Spills --9507731 / 1995-09-25 --259596 --1995-09-25	BROOK AVE/BRUCKNER BLVD	BROOK AVE/BRUCKNER BLVD BRONX, NY	0.03 North	- 1	135

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
D31	RCRA NonGen / NLR CON EDISON MANHOLE 1391 --NYP004140059		BRUCKNER BLVD & BROOK AVE BRONX, NY 10454	0.04 NNW	- 1	137
D32	NY Spills --9800381 / 1998-04-13 --199904 --1998-04-09	MANHOLE MH-21948	BRUCKNER BLVD & BROOK AVE BRONX, NY	0.04 NNW	- 1	141
D33	NY Spills --0705761 / 2007-11-08 --386130 --2007-08-20	ONE QT DIELECTRIC FLUID IN MH	BRUCKNER BLVD & BROOK STR BRONX, NY	0.04 NNW	- 1	143
D34	NY Spills --0705779 / 2007-09-20 --386150 --2007-08-20	ONE QT FROM OPEN CABLE ENDS IN	BRUCKNER BLVD & BROOK AVE BRONX, NY	0.04 NNW	- 1	145
D35	RCRA NonGen / NLR CON EDISON MANHOLE 21987 --NYP004220760		BRUCKNER BLVD & BROOK AVE BRONX, NY 10454	0.04 NNW	- 1	147
D36	NY Spills --0705744 / 2007-09-20 --386110 --2007-08-19	SIX GAL OIL IN MANHOLE 21950	BRUCKNER BLVD AND BROOK A BRONX, NY	0.04 NNW	- 1	150
D37	RCRA NonGen / NLR CON EDISON --NYP004160933		BRUCKNER BLVD & BROOK AVE BRONX, NY 10455	0.04 NNW	- 1	152
D38	RCRA NonGen / NLR CON EDISON --NYP004751731		BRUCKNER BLVD & BROOK AVE BRONX, NY 10454	0.04 NNW	- 1	155
D39	RCRA NonGen / NLR CON EDISON --NYP004157657		125 BRUCKNER BLVD BRONX, NY 10455	0.04 NNE	- 1	159
40	LTANKS --8809318 / 2003-03-05 --109456 --1989-03-02	CLOSED-LACKOF RECENT INFO	(NO STREET INFO) BRONX, NY	0.04 ESE	- 1	162

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
D41	RCRA NonGen / NLR CON EDISON --NYP004783882		121 BRUCKNER BLVD BRONX, NY 10454	0.04 NNE	- 1	164
E42	RCRA NonGen / NLR AAMCO TRANSMISSIONS --NYD986905693		131 BRUCKNER BLVD BRONX, NY 10454	0.04 NE	- 1	167
E43	RCRA-LQG --NYP004152963	CON EDISON - MANHOLE 21953	F/O 131 BRUCKNER BLVD BET BRONX, NY 10451	0.04 NE	- 1	171
E44	NY Spills --1507086 / 2015-10-06 --514542 --2015-10-06	STREET	131 BRUCKNER BLVD. BRONX, NY	0.04 NE	- 1	175
F45	NY Spills --0007008 / 2001-11-27 --75151 --2000-09-13	MANHOLE #29292	E 132ND ST & ST ANNES AVE BRONX, NY	0.04 SSE	+ 0	177
F46	NY Spills --9912889 / 2003-07-10 --264430 --2000-02-12	MANHOLE 6019	132ND ST & ST ANNES BRONX, NY	0.04 SSE	+ 0	179
F47	NY Spills --0007026 / 2001-11-27 --68266 --2000-09-14	MANHOLE #29291	132ND ST & ST ANNES AV BRONX, NY	0.04 SSE	+ 0	181
F48	NY Spills --0007024 / 2001-11-27 --68265 --2000-09-14	MANHOLE #29292	132ND ST & ST ANNES AV BRONX, NY	0.04 SSE	+ 0	183
F49	NY Spills --9911291 / 2002-03-28 --75152 --1999-12-27	MANHOLE 29291	E 132ND ST & ST ANNES AVE BRONX, NY	0.04 SSE	+ 0	185
B50	RCRA NonGen / NLR CON EDISON --NYP004765160		520 E 132ND ST FRONT OF BRONX, NY 10454	0.05 West	+ 0	187

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
G51	RCRA NonGen / NLR INTREPID MAINTENANCE CORP --NYU005000484		119 BRUCKNER BLVD BRONX, NY 10454	0.05 NNW	- 1	190
G52	RCRA NonGen / NLR CON EDISON --NYP004809012		119 BRUCKNER BLVD BRONX, NY 10454	0.05 NNW	- 1	196
G53	RCRA-VSQG --NYR000124909	BRUCKNER BROOK GASOLINE CORP	119 BRUCKNER BLVD BRONX, NY 10473	0.05 NNW	- 1	199
G54	UST	MOBIL S/S 17-634 BRUCKNER S/S	119 BRUCKNER BOULEVARD BRONX, NY 10454	0.05 NNW	- 1	204
G55	RCRA NonGen / NLR CON EDISON MANHOLE 21948 --NYP004241899		119 BRUCKNER BLVD BRONX, NY 10454	0.05 NNW	- 1	236
H56	VCP	82 BROWN PLACE	82 BROWN PLACE NEW YORK CITY, NY	0.05 WNW	+ 0	239
I57	SWF/LF	HARLEM RIVER YARD TS	ST. ANN'S & LINCOLN AVE A BRONX, NY 10454	0.06 East	- 1	240
J58	RCRA NonGen / NLR SHELL SERVICE STATION --NY0001493014		114 BRUCKNER BLVD BRONX, NY 10454	0.06 NW	+ 0	241
J58	NY Spills --0013495 / 2002-07-11 --0303604 / 2009-12-07 --0203687 / 2004-10-25 --292389 --292390 --163323 *Additional key fields are available in the Map Findings section	SHELL SERVICE STATION	114 BRUCKNER BLVD BRONX, NY 10454	0.06 NW	+ 0	247
J58	LTANKS --9413289 / 2003-02-25 --9801880 / 2003-02-25 --0007588 / 2004-10-25 --307768 --292391 --163322 *Additional key fields are available in the Map Findings section	SHELL SERVICE STATION	114 BRUCKNER BLVD BRONX, NY 10454	0.06 NW	+ 0	254
J59	UST	SHELL SVC. STA. 138576	114 BRUCKNER BOULEVARD BRONX, NY 10454	0.06 NW	+ 0	259

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
K60	RCRA NonGen / NLR CON EDISON MANHOLE 5969 --NYP004232989		E132ND ST & ST ANNS AVE BRONX, NY 10451	0.06 SE	- 1	272
K61	NY Spills --0510669 / 2006-03-27 --356687 --2005-12-12	DRUM RUN - 11 DRUMS	EAST 132ND/ST ANNES BRONX, NY	0.06 SE	- 1	275
K62	NY Spills --0613329 / 2007-06-01 --378340 --2007-03-12	HARLEM RIVER YARDS SITE	SAINT ANNE'S/ 132ND AVE BRONX, NY	0.06 SE	- 1	277
K63	NY Spills --1204530 / 2012-08-09 --467418 --2012-07-26	HARLEM RIVER POWER PLANT UNIT	132ND ST/ ST ANN ST BRONX, NY	0.06 SE	- 1	285
K64	NY Spills --0913975 / 2009-02-05 --433069 --2009-01-24	215294; E 132ND STREET AND ST.	E 132ND STREET AND ST. AN NEW YORK, NY	0.06 SE	- 1	287
K65	RCRA NonGen / NLR CON EDISON --NYP004844904		SAINT ANNS AVE & E 132ND BRONX, NY 10454	0.06 SE	- 1	289
K66	RCRA NonGen / NLR CON EDISON MANHOLE 29292 --NYP004145850		E 132 ST & ST ANNS BRONX, NY 10454	0.06 SE	- 1	292
K67	RCRA NonGen / NLR CON EDISON --NYP004789269		132ND ST & ST ANNS AVE BRONX, NY 10454	0.06 SE	- 1	296
K68	RCRA NonGen / NLR CON EDISON --NYP004844995		SAINT ANNS AVE & E 132ND BRONX, NY 10454	0.06 SE	- 1	299
K69	RCRA NonGen / NLR CON EDISON --NYP004751632		E 132ND ST & SAINT ANNS A BRONX, NY 10454	0.06 SE	- 1	303
K70	NY Spills --1007828 / 2010-10-25 --441276 --2010-10-24	HARLEM RIVER YARD POWER PLANT	132ND AND ST ANNES BRONX, NY	0.06 SE	- 1	307

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
K71	NY Spills --0111389 / 2002-04-16 --149639 --2002-03-02	MANHOLE 24738	E 132 ST & ST ANNES AV BRONX, NY	0.06 SE	- 1	309
K72	RCRA NonGen / NLR CON EDISON --NYP004757860		E 132ND ST & SAINT ANNS A BRONX, NY 10454	0.06 SE	- 1	312
K73	NY Spills --1604543 / 2016-08-08 --531054 --2016-07-31	POWER PLANT	EAST 132 AND ST. ANN'S BRONX, NY	0.06 SE	- 1	315
L74	NY Spills --0303706 / 2003-08-27 --321432 --2003-07-08	MANHOLE #23756	132ND ST (KILLS RR PROP) BRONX, NY	0.06 WSW	- 3	317
L75	NY Spills --0403789 / 2004-12-30 --220052 --2004-07-09	MANHOLE # 23756	EAST 132 ND STREET WESTSI BRONX, NY	0.06 WSW	- 3	319
L76	NY Spills --9612518 / 2007-03-30 --202755 --1997-01-21	NYS DOT PROPERTY	OLD HARLEM RIVER RR YARD BRONX, NY	0.06 WSW	- 3	321
L77	NY Spills --9811395 / 2001-01-19 --179064 --1998-12-10	MANHOLE #23756	BRONX KILLS RAILRD YARD BRONX, NY	0.06 WSW	- 3	323
L78	NY Spills --8912494 / 2003-02-26 --0409552 / 2005-05-18 --123054 --334391 --1989-12-29 --2004-11-24 *Additional key fields are available in the Map Findings section	MANHOLE 23756	E 132ND ST BRONX, NY	0.06 WSW	- 3	325
I79	RCRA NonGen / NLR CON EDISON --NYP004735403		BRUCKNER BLVD & SAINT ANN BRONX, NY 10454	0.06 East	- 1	328

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
H80	NY Spills --0302987 / 2006-09-14 --294156 --2003-06-20	BRONX EAST SIDE PARCEL POST AN	500 EAST 132ND STREET BRONX, NY 10454	0.06 WNW	+ 1	331
H80	UST	BRONX EAST SIDE PARCEL POST AN	500 EAST 132ND STREET BRONX, NY 10454	0.06 WNW	+ 1	334
H81	RCRA NonGen / NLR USPS - BRONX VMF & ADMIN OFFI --NY2180010454		500 E 132ND ST BRONX, NY 10454	0.06 WNW	+ 1	337
I82	NY Spills --0007117 / 2000-10-27 --284375 --2000-09-16	MANHOLE 3007	BRUCKNER BL/ST ANNES AV BRONX, NY	0.06 East	- 1	342
I83	NY Spills --0502781 / 2005-08-19 --347214 --2005-06-07	MANHOLE 22004	BRUCKNER BLVD/ SAINT ANNE BRONX, NY	0.06 East	- 1	344
I84	NY Spills --0000300 / 2002-01-17 --324431 --2000-04-07	MANHOLE # 29670	ST ANNES AVE/BRUCKNER AV BRONX, NY	0.06 East	- 1	346
I85	NY Spills --0007415 / 2001-11-28 --0009587 / 2001-05-07 --77860 --189903 --2000-09-25 --2000-11-21 *Additional key fields are available in the Map Findings section	MANHOLE 30007	BRUCKNER BLVD/ST ANNES PL BRONX, NY	0.06 East	- 1	348
I86	NY Spills --0010663 / 2001-07-05 --315567 --2000-12-23	MANHOLE #22002	E 133RD ST/ST ANN AVE BRONX, NY	0.06 East	- 1	351
I87	RCRA NonGen / NLR CON EDISON MANHOLE 21998 --NYP004220711		ST ANNS AVE & BRUCKNER BL BRONX, NY 10454	0.07 East	- 1	353
I88	NY Spills --9512219 / 1995-12-29 --232425 --1995-12-29	MERIT GAS STATION	BRUCKNER BLVD / ST ANNS BRONX, NY	0.07 East	- 1	356

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
M89	NY Spills --0890404 / 2010-08-16 --399492 --2007-11-26	208967; OPP 534-536 E134 ST &	OPP 534-536 E134 ST & BRO BRONX, NY	0.07 NE	- 1	358
G90	UST	BARAK SPEEDY LUBE	115 BRUCKNER BOULEVARD BRONX, NY 10454	0.07 NNW	+ 0	360
G91	RCRA NonGen / NLR CON EDISON SERVICE BOX: 21946 --NYP004544896		115 BRUCKNER BLVD FRONT O BRONX, NY 10454	0.07 NNW	+ 0	365
H92	RCRA NonGen / NLR CON EDISON --NYP004836910		E 132ND ST & BROWN PL BRONX, NY 10475	0.07 WNW	+ 3	369
H93	NY Spills --0108461 / 2003-01-31 --214638 --2001-11-21	SPILL NUMBER 0108461	EAST 132ND ST & BROWN PL BRONX, NY	0.07 WNW	+ 3	373
I94	NY Spills --1503751 / 2015-07-08 --510068 --2015-07-07	EAST RIVER	158 BRUCKENER BLVD BRONX, NY 10454	0.07 East	- 1	375
I95	NY Spills --0810149 / 2008-12-11 --407663 --2008-12-10	158 BRUKMER BLVD/ BRONX GRIT C	158 BRUKMER BLVD BRONX, NY	0.07 East	- 1	377
I96	RCRA-LQG --NYR000083857	NYC DEP BWT BRONX GRIT CHAMBER	158 BRUCKNER BLVD BRONX, NY 10454	0.07 East	- 1	379
I97	NY Spills --0607426 / 2006-09-29 --0503678 / 2005-06-28 --0801139 / 2008-04-29 --371145 --348339 --397013 *Additional key fields are available in the Map Findings section	BRONX GRID CHAMBER	158 BRUCKNER BOULEVARD BRONX, NY	0.07 East	- 1	388
I98	UST	BRONX GRIT CHAMBER	158 BRUCKNER BOULEVARD BRONX, NY 10454	0.07 East	- 1	392

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
I99	NY Spills --1302966 / 2013-06-19 --483422 --2013-06-18	WASTE WATER BRONX GRIT CHAMBER	158 BRUCKNER AVE. BRONX, NY	0.07 East	- 1	393
I100	NY Spills --0505949 / 2005-08-15 --0313238 / 2009-05-01 --0400675 / 2004-04-21 --0810210 / 2008-12-12 --0410975 / 2005-01-11 --0500342 / 2005-04-08 *Additional key fields are available in the Map Findings section	NYCDEP BRONX GRIT CHAMBER	BRUCKNER BLVD BRONX, NY 10454	0.07 East	- 1	395
I100	LTANKS --9905318 / 2009-05-01 --138623 --1999-08-03	NYCDEP BRONX GRIT CHAMBER	BRUCKNER BLVD BRONX, NY 10454	0.07 East	- 1	405
M101	RCRA NonGen / NLR CON EDISON SERVICE BOX: 6163 --NYP004550299		536 E 134TH ST BRONX, NY 10454	0.07 NE	- 1	407
J102	NY Spills --0002251 / 2004-03-24 --237886 --2000-05-23	MANHOLE 21981	BROWN PL/BRUCKNER BLVD BRONX, NY	0.08 NW	+ 3	411
J103	NY Spills --0007932 / 2001-12-14 --104560 --2000-10-05	MANHOLE 1249	BRUCKNER BLVD/BROWN PL BRONX, NY	0.08 NW	+ 3	413
J104	NY Spills --9914262 / 2002-03-26 --131745 --2000-03-17	TM694	BROWN PL / BRUCKNER BLVD BRONX, NY	0.08 NW	+ 3	415
J105	NY Spills --0108978 / 2004-09-10 --104561 --2001-12-10	MH 21981	BRUCKNER BLVD/BROWN PL BRONX, NY	0.08 NW	+ 3	417
J106	NY Spills --0409507 / 2005-12-27 --334260 --2004-11-23	MANHOLE #21937	BUCKNER BLVD&BROWN PLACE BRONX, NY	0.08 NW	+ 3	419

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
J107	NY Spills --0002175 / 2004-03-24 --290661 --2000-05-21	TM 694	BROWN PLACE/BRUCKNER BLVD BRONX, NY	0.08 NW	+ 3	421
I108	NY Spills --0410584 / 2004-12-24 --335597 --2004-12-23	BRONX GRID CHAMBER	158 BRUCKMER AVE. BRONX, NY	0.08 ESE	- 1	423
I109	NY Spills --0814452 / 2008-10-19 --0814456 / 2008-09-20 --432723 --432385 --2008-09-10 --2008-09-11 *Additional key fields are available in the Map Findings section	213560; 150 BRUCKNER BLVD	150 BRUCKNER BLVD NEW YORK, NY	0.08 ESE	- 1	425
J110	RCRA NonGen / NLR CON EDISON MANHOLE 1250 --NYP004140091		BROWN PL & BRUCKNER BLVD BRONX, NY 10451	0.08 NW	+ 3	428
J111	RCRA NonGen / NLR CON EDISON MANHOLE: 21981 --NYP004532032		BRUCKNER BLVD & BROWN PL BRONX, NY 10457	0.08 NW	+ 3	432
J112	RCRA NonGen / NLR CON EDISON MANHOLE: 21983 --NYP004477261		BROWN PL & BRUCKNER BLVD BRONX, NY 10451	0.08 NW	+ 3	436
J113	NY Spills --0914447 / 2009-09-06 --433861 --2009-09-05	218329; BRUCKNER BLVD. AND BRO	BRUCKNER BLVD. AND BROWN BRONX, NY	0.08 NW	+ 3	439
J114	NY Spills --0509280 / 2005-12-16 --355036 --2005-11-02	MANHOLE #1249	BRUCKNER BLVD & BROWN PLA BRONX, NY	0.08 NW	+ 3	441
N115	NY Spills --9710619 / 1997-12-17 --71586 --1997-12-17	SIDEWALK INFRONT OF	500 EAST 134TH ST BRONX, NY	0.08 North	- 1	443

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
O116	NY Spills --0000158 / 2000-05-12 --0000159 / 2000-04-05 --69628 --69629 --2000-04-04	MANHOLE #2644	150 BRUCKNER BLVD BRONX, NY	0.08 ESE	- 1	445
O116	LTANKS --0112160 / 2003-03-21 --69630 --2002-03-18	MANHOLE #2644	150 BRUCKNER BLVD BRONX, NY	0.08 ESE	- 1	448
O117	UST	AMERICAN BUILDING SUPPLY CORP.	150 BRUCKNER BLVD. BRONX, NY 10454	0.08 ESE	- 1	451
N118	NY Spills --0104552 / 2001-07-31 --69555 --2001-07-28	BROOK AV	E134TH ST BRONX, NY	0.08 North	- 1	458
N119	NY Spills --9811310 / 2003-02-13 --127589 --1998-12-08	MANHOLE #1399	E 134TH ST/ BROOK AVE BRONX, NY	0.08 North	- 1	460
N120	RCRA NonGen / NLR CON EDISON MANHOLE 1399 --NYP004144515		134 ST & BROOK AVE BRONX, NY 10451	0.08 North	- 1	462
N121	RCRA NonGen / NLR CON EDISON MANHOLE 1399 --NYP004144358		134 ST & BROOK AVE BRONX, NY 10451	0.08 North	- 1	466
P122	NY Spills --1113969 / 2012-03-15 --462001 --2012-03-15	CASTLE OIL TO ROADWAY APPROX 1	NEAR 151 BRUCKNER BLVD BRONX, NY	0.09 East	+ 0	470
Q123	RCRA NonGen / NLR WEDTECH CORP --NYD982273740		112 BRUCKNER BLVD BRONX, NY 10451	0.09 NW	+ 7	472
Q124	UST	112 BRUCKNER ASSOCIATES,LP	112 BRUCKNER BLVD BRONX, NY 10454	0.09 NW	+ 7	478
R125	NY Spills --1506954 / 2015-12-29 --514404 --2015-10-01	111 BRUCKNER BLVD LLC	111 BRUCKNER BLVD BRONX, NY	0.09 NNW	+ 7	481

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
R126	RCRA NonGen / NLR CON EDISON --NYP004811754		133 BROWN PL BRONX, NY 10454	0.10 NNW	+ 11	483
S127	NY Spills --0814444 / 2008-09-22 --432587 --2008-09-08	213535; E134 ST AND ST ANN'S A	E134 ST AND ST ANN'S AVE NEW YORK, NY	0.10 ENE	- 1	486
S128	NY Spills --0814420 / 2008-09-30 --432571 --2008-08-27	213385; E 134 ST AND ST. ANN'S	E 134 ST AND ST. ANN'S AV NEW YORK, NY	0.10 ENE	- 1	488
S129	NY Spills --0509110 / 2005-11-28 --354832 --2005-10-29	VACANT TRAILER	ST ANNS AVE / E 134 ST NEW YORK, NY	0.10 ENE	- 1	490
S130	NY Spills --1204408 / 2012-08-03 --467293 --2012-08-02	HARLEM RIVER POWER PLANT	134TH STREET / ST. ANNS S BRONX, NY	0.10 ENE	- 1	492
S131	NY Spills --0000118 / 2002-01-17 --0209210 / 2003-02-21 --289138 --289139 --2000-04-04 --2002-12-07 *Additional key fields are available in the Map Findings section	MH29559	ST ANNS AV/EAST 134 ST BRONX, NY	0.10 ENE	- 1	494
S132	NY Spills --9807836 / 2002-12-30 --68069 --1998-09-27	MANHOLE 12350	134TH ST & ST ANNS BRONX, NY	0.10 ENE	- 1	497
S133	NY Spills --9811506 / 2003-02-19 --305201 --1998-12-13	MANHOLE 6161	EAST 134 ST & ST ANNS AV BRONX, NY	0.10 ENE	- 1	499
S134	NY Spills --9810958 / 2003-02-14 --305200 --1998-12-01	MANHOLE 12350	EAST 134 ST & ST ANNS AV BRONX, NY	0.10 ENE	- 1	501

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
P135	UST	O'BRIEN SANITATION CORP	155 BRUCKNER BLVD BRONX, NY 10454	0.10 East	+ 1	503
P135	SWF/LF	O'BRIEN SANITATION CORP	155 BRUCKNER BLVD BRONX, NY 10454	0.10 East	+ 1	506
T136	NY Spills --9415509 / 2004-04-29 --154762 --1995-02-27	NYCDEP-SEWAGE TREATMENT	158 BUECKNER BLVD BRONX, NY	0.11 East	+ 0	507
U137	RCRA NonGen / NLR CON EDISON --NYP004783932		600 E 132ND ST BRONX, NY 10454	0.11 SE	+ 0	509
U138	RCRA NonGen / NLR CON EDISON --NYP004765152		600 E 132ND ST FRONT OF BRONX, NY 10454	0.11 SE	+ 0	512
U139	RCRA-LQG --NYP005152780	CON EDISON - MANHOLE M29292	600 E 132ND ST BRONX, NY 10454	0.11 SE	+ 0	515
Q140	NY Spills --9202017 / 2003-03-14 --1109783 / 2011-11-04 --271873 --457565 --1992-05-16 --2011-11-04 *Additional key fields are available in the Map Findings section	102 BRUCKNER BLVD/MUFFLER	102 BRUCKNER BLVD BRONX, NY	0.11 NW	+ 10	519
Q141	RCRA NonGen / NLR SERVICE STATION --NYD000698597		102 BRUCKNER BLVD BRONX, NY 10454	0.11 NW	+ 10	522
Q142	RCRA NonGen / NLR CON EDISON --NYP004740197		102 BRUCKNER BLVD FRONT O BRONX, NY 10454	0.11 NW	+ 10	527
Q143	UST	APPLE AUTO & TRUCK CARE, INC.	102 BRUCKNER BOULEVARD BRONX, NY 10454	0.11 NW	+ 10	530
144	NY Spills --9814306 / 2004-01-22 --162555 --1999-02-28	SPILL NUMBER 9814306	135TH ST & ST ANNE'S AVE BRONX, NY	0.11 NE	+ 16	544

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
T145	RCRA NonGen / NLR CON EDISON --NYP004750014		SAINT ANNS PL VAULT 2644 BRONX, NY 10454	0.12 ESE	- 1	546
T146	RCRA NonGen / NLR CON EDISON --NYP004750006		SAINT ANNS PL VAULT 2130 BRONX, NY 10454	0.12 ESE	- 1	549
T147	RCRA NonGen / NLR CON EDISON --NYP004750022		SAINT ANNS PL VAULT 2422 BRONX, NY 10454	0.12 ESE	- 1	552
U148	NY Spills --9906795 / 1999-11-09 --203749 --1999-09-07	MANHOLE 5969	132 ST BRONX, NY	0.12 SE	+ 0	555
149	RCRA NonGen / NLR CON EDISON --NYP004817995		468 E 134TH ST FRONT OF BRONX, NY 10454	0.12 NNW	+ 19	557
150	LTANKS --8903777 / 2003-03-05 --75113 --1989-07-14	CLOSED-LACKOF RECENT INFO	USPOSTAL SVC,510 E 133 ST BRONX, NY	0.13 ESE	+ 0	560
V151	US BROWNFIELDS --184862 --08/06/2014	SOUTH BRONX CHARTER SCHOOL	611 EAST 133RD STREET BRONX, NY 10454	0.16 ESE	+ 0	562
V152	VCP	SOUTH BRONX CHARTER SCHOOL - D	164 BRUCKNER BLVD NEW YORK CITY, NY	0.17 ESE	+ 0	576
153	SPDES --NY0276731	NYC DDC RANDALLS ISLAND WATER	BRONX TO RANDALLS ISLAND NEW YORK, NY	0.18 South	- 17	577
W154	LTANKS --9203924 / 2006-01-18 --9212748 / 1993-02-11 --95620 --106441 --1992-07-06 --1993-02-11 *Additional key fields are available in the Map Findings section	MILLBROOK -NYCHA	160 SAINT ANNS AVENUE BRONX, NY	0.19 NE	+ 8	578

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
W155	VCP	160 ST. ANN'S AVENUE - MILLBRO	160 ST. ANN'S AVENUE NEW YORK CITY, NY	0.19 NE	+ 8	582
156	SPDES --NYR10X505	FRESH DIRECT	ST. ANNS AVENUE BRONX, NY 10454	0.20 SSE	- 6	583
157	SPDES --NYR10W824	BRONX SHORE FIELDS	RANDALLS ISLAND NEW YORK, NY 10035	0.21 SSW	- 12	584
X158	LTANKS --0511553 / 2006-03-06 --357736 --2006-01-05	BUSINESS	91 BRUCKNER BLVD BRONX, NY	0.21 NW	+ 13	585
X159	LTANKS --1008706 / 2019-01-07 --442210 --2010-11-18	FIEDLER COMPANY INC.	91 BRUCKNER BLVD BRONX, NY 10454	0.21 NW	+ 13	587
160	CBS --Inactive --2-000442	ARISTY AUTO REPAIR & WRECKERS	136 ST 137 ST. BRONX, NY 10454	0.22 North	+ 12	590
161	SPDES --NYR10L918	RANDALL'S ISLAND WATER PARK	NEW YORK, NY 10001	0.22 SSW	- 11	591
162	US BROWNFIELDS --237104 ---	MILL BROOK TERRACE	570 E. 137TH STREET BRONX, NY 10454	0.24 NE	+ 10	592

Sites Summary Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

TOTAL: 179

GEOCODED: 173

NON GEOCODED: 6

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
	VCP --57637	CE - E. 137TH ST. STATION	136TH ST. - 137TH ST. BRONX, NY 10454	NON GC	N/A	N/A
	SWF/LF	HUTCH PKWY AND BRUCKNER EXPWY	BLOCK 4111, LOT 123 AND 1 BRONX, NY	NON GC	N/A	N/A
	SWF/LF	EAST 145TH STREET AND EAST RIV	BRUCKNER EXPY, E 141ST ST BRONX, NY	NON GC	N/A	N/A
	SEMS-ARCHIVE	NEW YORK SOLDER CO.	684, 690 E. 133RD ST. BRONX, NY 10454	NON GC	N/A	N/A
	SWF/LF	SOUTHERN BLVD. AND LONGWOOD AV	LONGWOOD AVE, LAFAYETTE A BRONX, NY	NON GC	N/A	N/A
	SWF/LF	ZEREGA AVE, CROSS BRONX EXPWY,	SHORELINE OF WESTCHESTER BRONX, NY	NON GC	N/A	N/A

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003790820 **DIST/DIR:** 0.000 **ELEVATION:** 19 **MAP ID:** A1

NAME: 220 EAST REALTY LLC **Rev:** 06/21/2021
ADDRESS: 517 EAST 132ND STREET
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

UST:
Name: 220 EAST REALTY LLC
Address: 517 EAST 132ND STREET
City,State,Zip: BRONX, NY 10454
Id/Status: 2-605835 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: N/A
UTM X: 590956.81326
UTM Y: 4517524.53371
Site Type: Trucking/Transportation/Fleet Operation

Affiliation Records:
Site Id: 27702
Affiliation Type: Facility Owner
Company Name: 220 EAST REALTY LLC
Contact Type: Not reported
Contact Name: Not reported
Address1: 2447 THIRD AVENUE
Address2: Not reported
City: BRONX
State: NY
Zip Code: 10454
Country Code: 001
Phone: (718) 585-3242
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 27702
Affiliation Type: Mail Contact
Company Name: 220 EAST REALTY LLC
Contact Type: Not reported
Contact Name: DAVE HALLAND
Address1: 2447 THIRD AVENUE
Address2: Not reported
City: BRONX
State: NY
Zip Code: 10454
Country Code: 001
Phone: (718) 585-3242
EMail: Not reported
Fax Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003790820 **DIST/DIR:** 0.000 **ELEVATION:** 19 **MAP ID:** A1

NAME: 220 EAST REALTY LLC **Rev:** 06/21/2021
ADDRESS: 517 EAST 132ND STREET
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 27702
Affiliation Type: Facility Operator
Company Name: 220 EAST REALTY LLC
Contact Type: Not reported
Contact Name: DAVE HALLAND
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 585-3242
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 27702
Affiliation Type: Emergency Contact
Company Name: 220 EAST REALTY LLC
Contact Type: Not reported
Contact Name: DAVE HALLAND
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 585-3242
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 001
Tank ID: 60547
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 1000

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003790820 **DIST/DIR:** 0.000 **ELEVATION:** 19 **MAP ID:** A1

NAME: 220 EAST REALTY LLC **Rev:** 06/21/2021
ADDRESS: 517 EAST 132ND STREET
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Install Date: Not reported
Date Tank Closed: 04/01/2001
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 002
Tank ID: 60548
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 1000
Install Date: Not reported
Date Tank Closed: 04/01/2001
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003790820 **DIST/DIR:** 0.000 **ELEVATION:** 19 **MAP ID:** A1

NAME: 220 EAST REALTY LLC **Rev:** 06/21/2021
ADDRESS: 517 EAST 132ND STREET
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Last Modified: 04/14/2017

Equipment Records:

C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction Dispenser
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
F00 - Pipe External Protection - None

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

FINDS

EDR ID: 1024372946 **DIST/DIR:** 0.000 **ELEVATION:** 19 **MAP ID:** A2

NAME: SPARKZ IRON WORKS CORP.

Rev: 05/05/2021

ADDRESS: 519 EAST 132 STREET
BRONX, NY 10454

ID/Status: 110070275655

SOURCE: US EPA

FINDS:

Registry ID: 110070275655

[Click Here:](#)

Environmental Interest/Information System:
OSHA ESTABLISHMENT

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000402537 **DIST/DIR:** 0.000 **ELEVATION:** 19 **MAP ID:** A3

NAME: 220 EAST REALTY INC. **Rev:** 06/21/2021

ADDRESS: 511-517 EAST 132 STREET
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

UST:

Name: 220 EAST REALTY INC.
Address: 511-517 EAST 132 STREET
City,State,Zip: BRONX, NY 10454
Id/Status: 2-309036 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: N/A
UTM X: 590932.31491
UTM Y: 4517526.10474
Site Type: Trucking/Transportation/Fleet Operation

Affiliation Records:

Site Id: 14069
Affiliation Type: Facility Owner
Company Name: 220 EAST REALTY INC.
Contact Type: Not reported
Contact Name: Not reported
Address1: 511-517 EAST 132 STREET
Address2: Not reported
City: BRONX
State: NY
Zip Code: 10454
Country Code: 001
Phone: (718) 401-1511
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 14069
Affiliation Type: Mail Contact
Company Name: 220 EAST REALTY INC.
Contact Type: Not reported
Contact Name: DAVE HOLLAND
Address1: 2447 THIRD AVENUE
Address2: Not reported
City: BRONX
State: NY
Zip Code: 10454
Country Code: 001
Phone: (718) 585-3242
EMail: Not reported
Fax Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000402537 **DIST/DIR:** 0.000 **ELEVATION:** 19 **MAP ID:** A3

NAME: 220 EAST REALTY INC. **Rev:** 06/21/2021
ADDRESS: 511-517 EAST 132 STREET
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 14069
Affiliation Type: Facility Operator
Company Name: 220 EAST REALTY INC.
Contact Type: Not reported
Contact Name: MOSHE ALTMARK
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 401-1511
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 14069
Affiliation Type: Emergency Contact
Company Name: 220 EAST REALTY INC.
Contact Type: Not reported
Contact Name: MOSHE ALTMARK
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 401-1511
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 001
Tank ID: 17766
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 3000

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000402537 **DIST/DIR:** 0.000 **ELEVATION:** 19 **MAP ID:** A3

NAME: 220 EAST REALTY INC. **Rev:** 06/21/2021
ADDRESS: 511-517 EAST 132 STREET
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 21
Date Test: 09/22/2000
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None
D10 - Pipe Type - Copper

Tank Number: 002
Tank ID: 17767
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 3000
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 21
Date Test: 09/22/2000
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000402537 DIST/DIR: 0.000 ELEVATION: 19 MAP ID: A3

NAME: 220 EAST REALTY INC. Rev: 06/21/2021
ADDRESS: 511-517 EAST 132 STREET
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Last Modified: 04/14/2017

Equipment Records:

D10 - Pipe Type - Copper
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None

Tank Number: 003
Tank ID: 60706
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 3000
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0008
Common Name of Substance: Diesel

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000402537 DIST/DIR: 0.000 ELEVATION: 19 MAP ID: A3

NAME: 220 EAST REALTY INC. Rev: 06/21/2021
ADDRESS: 511-517 EAST 132 STREET
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tank Number: 010
Tank ID: 48353
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 07/01/1994
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
G00 - Tank Secondary Containment - None
D00 - Pipe Type - No Piping
J00 - Dispenser - None
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 011
Tank ID: 48354
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 07/01/1994
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000402537 **DIST/DIR:** 0.000 **ELEVATION:** 19 **MAP ID:** A3

NAME: 220 EAST REALTY INC. **Rev:** 06/21/2021

ADDRESS: 511-517 EAST 132 STREET
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
D00 - Pipe Type - No Piping
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
J00 - Dispenser - None

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

FINDS

EDR ID: 1018313767 **DIST/DIR:** 0.000 **ELEVATION:** 19 **MAP ID:** A4

NAME: BRIGHT LIGHT CONSTRUCTION LLC.

Rev: 05/05/2021

ADDRESS: 517 EAST 132ND STREET, 1ST FLOOR
BRONX, NY 10454
BRONX COUNTY

ID/Status: 110066856502

SOURCE: US EPA

FINDS:

Registry ID: 110066856502

[Click Here:](#)

Environmental Interest/Information System:

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and it Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

ICIS

EDR ID: 1018313767 **DIST/DIR:** 0.000 **ELEVATION:** 19 **MAP ID:** A4

NAME: BRIGHT LIGHT CONSTRUCTION LLC.

Rev: 11/18/2016

ADDRESS: 517 EAST 132ND STREET, 1ST FLOOR
BRONX, NY 10454
BRONX COUNTY

ID/Status: 110066856502

SOURCE: US Environmental Protection Agency

ICIS:

Enforcement Action ID: 02-200129839

FRS ID: 110066856502

Action Name: Bright Light Construction LLC TSCA Lead Inspection

Facility Name: BRIGHT LIGHT CONSTRUCTION LLC.

Facility Address: 517 EAST 132ND STREET, 1ST FLOOR
BRONX, NY 10454

Enforcement Action Type: Information Request Letter

Facility County: Not reported

Program System Acronym: ICIS

Enforcement Action Forum Desc: Administrative - Informal

EA Type Code: IRL

Facility SIC Code: 1522

Federal Facility ID: Not reported

Latitude in Decimal Degrees: 40.80368

Longitude in Decimal Degrees: -73.92149

Permit Type Desc: Not reported

Program System Acronym: 3600095533

Facility NAICS Code: 236118

Tribal Land Code: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U001838894 **DIST/DIR:** 0.009 North **ELEVATION:** 18 **MAP ID:** A5

NAME: MOBIL S/S 1JARDH AAMCO TRANAS **Rev:** 06/21/2021

ADDRESS: MOBIL S/S 1JARDH AAMCO TRANAS
BRONX, NY 10400
BRONX

SOURCE: NY Department of Environmental Conservation

UST:

Name: MOBIL S/S 1JARDH AAMCO TRANAS
Address: MOBIL S/S 1JARDH AAMCO TRANAS
City,State,Zip: BRONX, NY 10400
Id/Status: 2-156418 / Inactive
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: N/A
UTM X: Not reported
UTM Y: Not reported
Site Type: Unknown

Affiliation Records:

Site Id: 5122
Affiliation Type: Facility Owner
Company Name: MOBIL OIL CORP;ATT:A.J.PRINGLE
Contact Type: Not reported
Contact Name: Not reported
Address1: 3225 GALLOWS RD.; ENV.ENGINEER
Address2: Not reported
City: FAIRFAX
State: VA
Zip Code: 22037
Country Code: 001
Phone: (703) 849-5862
EMail: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 2010-03-10

Site Id: 5122

Affiliation Type: Mail Contact
Company Name: MOBIL OIL CORP;ATT:A.J.PRINGLE
Contact Type: Not reported
Contact Name: Not reported
Address1: PO BOX 142667
Address2: Not reported
City: AUSTIN
State: TX
Zip Code: 78714
Country Code: 001
Phone: (703) 849-5862
EMail: Not reported
Fax Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U001838894 **DIST/DIR:** 0.009 North **ELEVATION:** 18 **MAP ID:** A5

NAME: MOBIL S/S 1JARDH AAMCO TRANAS **Rev:** 06/21/2021
ADDRESS: MOBIL S/S 1JARDH AAMCO TRANAS
BRONX, NY 10400
BRONX
SOURCE: NY Department of Environmental Conservation

Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 5122
Affiliation Type: Facility Operator
Company Name: MOBIL S/S 1JARDH AAMCO TRANAS
Contact Type: Not reported
Contact Name: AAMCO TRANS
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: Not reported
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 5122
Affiliation Type: Emergency Contact
Company Name: MOBIL OIL CORP;ATT:A.J.PRINGLE
Contact Type: Not reported
Contact Name: AAMCO TRANS
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: Not reported
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 001
Tank ID: 27281
Tank Status: Tank Converted to Non-Regulated Use
Material Name: Tank Converted to Non-Regulated Use
Capacity Gallons: 1500

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U001838894 **DIST/DIR:** 0.009 North **ELEVATION:** 18 **MAP ID:** A5

NAME: MOBIL S/S 1JARDH AAMCO TRANAS **Rev:** 06/21/2021

ADDRESS: MOBIL S/S 1JARDH AAMCO TRANAS
BRONX, NY 10400
BRONX

SOURCE: NY Department of Environmental Conservation

Install Date: 12/01/1978
Date Tank Closed: 12/01/1999
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S102144330 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A6

NAME: 126 BRUCKNER BLVD.BRONX /

Rev: 08/09/2021

ADDRESS: 126 BRUCKNER BLVD.
BRONX, NY
BRONX

ID/Status: 8606553 / 1987-10-23

ID/Status: 208428

ID/Status: 1987-01-22

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: 126 BRUCKNER BLVD.BRONX /

Address: 126 BRUCKNER BLVD.

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 8606553 / 1987-10-23

Facility ID: 8606553

Facility Type: ER

DER Facility ID: 172940

Site ID: 208428

DEC Region: 2

Spill Cause: Human Error

Spill Class: Not reported

SWIS: 0301

Spill Date: 1987-01-22

Investigator: UNASSIGNED

Referred To: Not reported

Reported to Dept: 1987-01-22

CID: Not reported

Water Affected: NONE

Spill Source: Gasoline Station or other PBS Facility

Spill Notifier: Responsible Party

Cleanup Ceased: 1987-10-23

Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1987-02-11

Spill Record Last Update: 2004-09-30

Spiller Name: Not reported

Spiller Company: ISLAND TRANSPORTATION

Spiller Address: Not reported

Spiller Company: 001

Contact Name: Not reported

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was "

Remarks: "SPILLER WILL CLEAN UP"

All Materials:

Site ID: 208428

Operable Unit ID: 903334

Operable Unit: 01

Material ID: 472116

Material Code: 0009

Material Name: gasoline

Case No.: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S102144330	DIST/DIR:	0.015 NE	ELEVATION:	18	MAP ID:	A6

NAME: 126 BRUCKNER BLVD.BRONX /

Rev: 08/09/2021

ADDRESS: 126 BRUCKNER BLVD.
BRONX, NY
BRONX

ID/Status: 8606553 / 1987-10-23
ID/Status: 208428
ID/Status: 1987-01-22

SOURCE: NY Department of Environmental Conservation

Material FA: Petroleum
Quantity: 750.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104275675	DIST/DIR: 0.015 NE	ELEVATION: 18	MAP ID: A7

NAME: HESS STATION 32506

Rev: 08/09/2021

ADDRESS: 126-128 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9405017 / 2016-03-24
ID/Status: 68189
ID/Status: 1994-07-12

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: HESS STATION 32506
Address: 126-128 BRUCKNER BLVD
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 9405017 / 2016-03-24
Facility ID: 9405017
Facility Type: ER
DER Facility ID: 195568
Site ID: 68189
DEC Region: 2
Spill Cause: Unknown
Spill Class: C4
SWIS: 0301
Spill Date: 1994-07-12
Investigator: RJFENG
Referred To: SVE/AS STARTUP APPROVED
Reported to Dept: 1994-07-12
CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station or other PBS Facility
Spill Notifier: Responsible Party
Cleanup Ceased: 2011-09-21
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: True
Remediation Phase: 0
Date Entered In Computer: 1994-10-06
Spill Record Last Update: 2016-03-24
Spiller Name: Not reported
Spiller Company: MERIT OIL STATION
Spiller Address: 126-128 BRUCKNER BLVD
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
SUN 1/26/06: Case assigned to Carlson. Hess does not want to
remediate site until the upgradient site, former Gassman fuel company
spill case contamination is confirmed. 1/25/06 meeting with Quantum,
NYSDEC, and GSC/Kleinfelder: a bailing schedule will be kept and
absorbent socks will be placed in the wells containing free product.
6/29/06: Meeting with Hess, Quantum, EnviroTrac, GSC, and NYSDEC on
6/28/2006. Hess has been bailing product. They will not put in a
system until the upgradient Gassman site has been resolved. The
Department requested that Hess locally treat downgradient well MW-5.

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104275675 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A7

NAME: HESS STATION 32506

Rev: 08/09/2021

ADDRESS: 126-128 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9405017 / 2016-03-24

ID/Status: 68189

ID/Status: 1994-07-12

SOURCE: NY Department of Environmental Conservation

7/12/06: Reviewed the First triannual 2006 report. Product in four wells: MW8, MVE-2, MVE-3, SVE-1. Product was bailed roughly biweekly. Max BTEX 3,797 in MW5, max MTBE 934ppb in MW9. Upgradient Gassman property is the suspected source. See spill file 0101831. 8/25/06: Received email from Al Tonn: Kleinfelder is preparing a work plan for ORC injections around MW-5 as discussed at our last meeting. 10/4/06: RAP approved for ORC around MW5. Six injections points around MW5, total of 60 pounds of ORC. Slurry will be injected between 8 and 13 ft bg. Background sample will be collected from MW5 and MW4. Dissolved oxygen, pH, redox potential, dissolved ferrous iron, dissolved manganese, and alkalinity will be measured in the background samples, and during next two quarters. Gassman spill 0101831 still needs to be resolved before Hess will remediate the rest of the property. 10/31/06: Reviewed site status update report dated October 25, 2006. Wells sampled on 8/9/06. Product in four wells: MW8, MVE1, MVE2, and MVE3. Product is recovered monthly. Max BTEX 4060 (MW7), max MTBE 1850 (MW9). ORC will be injected surrounding MW5 in November. The upgradient spill on the gassman site has not been resolved yet. 12/18/06: Received email from Aaron Lapine of Delta: The initial ORC injection was completed by Kleinfelder on November 14, 2006 subsequent to the installation of 2 injection points around MW-5 and the collection of MNA samples from MW-4 and MW-5. We are scheduled to sample this site in December 2006 and then in April 2007 as part of the tri-annual schedule. The additional MNA parameters will be collected during these sampling events. Based on the analytical results it will be determined whether additional ORC injections are warranted. 1/17/07: Meeting on 1/16/07 with Hess, Delta, and NYSDEC 3/5/07: ORC injected around MW5 on 11/14/06. Wells sampled on 12/29/06. Product at depth of 0.01 ft in MW8. General decrease in contaminants and product thickness. Need to resolve upgradient gassman site. 6/15/07: Reviewed site status report. Wells sampled on 4/23/07. No LNAPL. Max BTEX 1,372 (MW5). Max MTBE 470 (MW9). Slight decrease in contaminants in MW5 after ORC injection. Upgradient spill (former Gassman) not resolved yet. 10/23/07: Reviewed update report. Wells sampled on 8/10/07. Max BTEX 1,326 ppb (SVE1), max MTBE 110 ppb (MW2). No LNAPL present. 3/10/08: Received FOIL request from Delta to review report for adjacent spill site (Gassman site, spill 0101831). 3/12/08: Reviewed October 2007 - January 2008 Site Status Report. Wells sampled on December 7, 2007. LNAPL present in four wells: MW3 (0.03 ft), MW8 (0.04 ft), MVE2 (0.03 ft), SVE1 (0.18 ft). Max BTEX 2,339 ppb (MW5), max MTBE 540 ppb (MW9). 5/7/08 - Carlson: Meeting with Hess, Envirotrac, and NYSDEC. Hess need to complete review of files for this spill and adjacent gassman site. 7/9/08 - Carlson: Reviewed meeting minutes. Requested that Hess submit a FOIL request to review files for adjacent Gassman

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104275675 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A7

NAME: HESS STATION 32506

Rev: 08/09/2021

ADDRESS: 126-128 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9405017 / 2016-03-24

ID/Status: 68189

ID/Status: 1994-07-12

SOURCE: NY Department of Environmental Conservation

site. Emailed them the previously submitted 1993 UST Closure Report, and 2000 fingerprinting analysis. 10/22/08 - Meeting with Hess, Envirotrac, and NYSDEC. Re-send 93 report and fingerprinting report to Hess. 11/6/08 - Carlson: Reviewed the October 2008 update report. Wells sampled on 8/29/08. Maximum BTEX concentration 1,187 ppb (MW5). Maximum MTBE concentration 683 ppb (MW9). LNAPL in three wells - MW8, MVE2, and SVE1. EFR events planned. Has Hess reviewed the Gassman file yet? 12/10/08: Emailed Hess/Envirotrac 93 report and fingerprinting report. 3/18/09 - Carlson: Meeting with Hess and Envirotrac. Hess did not receive emailed reports. Hess will FOIL Gassman file and submit RAP in July 2009. 3/25/09 - Carlson: Mailed cd with Envirotrac 93 report and 2000 fingerprinting report to Ed Russo. 5/7/09 - Carlson: Reviewed April 2009 Update Report. Wells sampled on 2/26/09. 0.1 ft of LNAPL in SVE1. Maximum BTEX concentration 8,181 ppb (MW5). Hess will review Gassman file and historic reports for the site. EFR conducted monthly. 8/10/09 - Carlson: Reviewed July 2009 Update Report. Wells sampled on 5/20/09. Sheenin MW8 and MVE2. EFR conducted monthly. Report states Hess will review historic files and Gassman case. 8/19/09 - Carlson: Meeting with Hess. Hess will review historic files and issue response. 9/22/09 - Carlson: Received letter dated 9/21/09 from Envirotrac regarding review of Gassman/Hess spills. Envirotrac did not receive review entire Gassman file. Left message for Ed Russo. They need to re-FOIL Gassman file and resubmit evaluation. Received email with FOIL application dated April 2009, gave to DEC Leung for processing. 11/17/09 - Carlson: Reviewed update report. Report states Gassman evaluation will be submitted in October - evaluation overdue. 1/26/2010 - Carlson: Received report on review of Gassman file. Report states Hess still feels Gassman is a source of contamination for Hess property. 1/27/2010 - Carlson: Meeting with Hess and Envirotrac. Gassman property only has low level impact present. It is not a significant source of petroleum contamination for Hess. A remedial action plan is required by March 2010. Hess does not have a copy of the November 2009 Gassman report. 2/5/2010 - Carlson: Reviewed 4th Quarter 2009 Update Report dated January 2010. Wells sampled on 11/12/2009. Maximum BTEX concentration 4,959 ppb (MW5). 2/16/2010 - Carlson: Issued letter requiring RAP by March 31, 2010. 4/13/2010 - Carlson: Approved Pilot Test Work Plan for installation of 5 air sparge wells and SVE/AS pilot testing. Pilot test report/RAP due 8/15/2010. 5/6/2010 - Carlson: Received email - drilling scheduled for 5/11/2010. 5/20/2010 - Carlson: Meeting held with Hess. Pilot test completed. Additional wells will be installed. 5/28/2010 - Carlson: Reviewed April 2010 update report. Pilot test study to be completed. 8/13/2010 - Carlson: Reviewed July 2010 Update Report. LNAPL in two wells. Six AS, two SVE well installed. MW8 reinstalled

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104275675	DIST/DIR: 0.015 NE	ELEVATION: 18	MAP ID: A7

NAME: HESS STATION 32506

Rev: 08/09/2021

ADDRESS: 126-128 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9405017 / 2016-03-24

ID/Status: 68189

ID/Status: 1994-07-12

SOURCE: NY Department of Environmental Conservation

in May 2010. Soil data for new wells included. 9/16/2010 - Carlson: Reviewed RAP. Several discrepancies between text and figures, product recovery not addressed. Sent email requiring revised RAWP in 30 days. 3/11/11 - Obligado - In response from request from Ed Russo, I sent a Stipulation and Corrective Action Plan to John Engdahl. Stipulation Agreement is necessary for air discharge. 3/23/11 - Obligado - I received a email request from Ed Russo requesting to star the system before Stipulation Agreement is signed. I rejected the request and also required a RAP Addendum with the following: 1) As Built System Design Drawings 2) Revised OMM Plan: During the proposed 30 day start-up period, air samples will collected for laboratory analysis on a weekly basis. Air samples will be analyzed for full list VOCs for 24 hour turnaround. Electronic copies of analytical results will be emailed to my attention. 3) SVES Data Sheet (Stipulation Guidance Appendix 2-1) 4) Contingency Plan for presence of LNAPL. 4/4/11 - Obligado - I received the Addendum. I emailed Ed Russo requiring P.E. Stamped design drawings. 5/9/11 - Obligado - RAP Addendum and Design Drawings Submitted. 10/28/2011 - Carlson: Received email notification - SVE/AS 30 day test period startup planned for 11/1/11. After 30 days system will be shut down and startup report submitted for DEC approval. 11/14/2011 - Carlson: Reviewed October 2011 Update Report. LNAPL hand bailed from MW8R and MVE1. System startup in progress. 12/6/11 - Carlson: Reviewed weekly SVE effluent air sample collected on 11/9/11 during 30 day system startup. Benzene is below discharge limit. 12/19/11 - Carlson: Reviewed email with weekly SVE effluent air sample collected on 11/17/11. Benzene is below discharge limit. 12/30/11 - Carlson: Reviewed email with weekly SVE effluent air sample collected on 11/23/11. Benzene is below discharge limit. Reviewed email with weekly SVE effluent air sample collected on 11/30/11. Benzene is below discharge limit. 1/31/2012 - Carlson: Received system startup report. Benzene emission is within standard. System is operating as designed. Approved of system startup. 2/7/2012 - Carlson: Received email - system startup scheduled for 2/8/2012. 8/24/2012 - 1Q2012, 4/30/2012, by EnviroTrac. The groundwater was sampled 2/8/2012. DTW 7.81 to 11.64'. Flows to northeast. SVE/AS is operating. MW-5, 2,990.6 BTEX, MTBE ND. MW-2, 7.26J BTEX, 26.2 MTBE. MVE-3, 309.1 BTEX, 67.6 MTBE. MW-7, 65.8 BTEX, 9.3 MTBE. MW-9, 506.3 BTEX, 185 MTBE. MW-8R, 79.14J BTEX, 14.9 MTBE. MVE-1, 15.8 BTEX, 24.5 MTBE. MVE-2, 246.7 BTEX, 43.3 MTBE. SVE-1, 9.01J BTEX, 9.6 MTBE. No SVE effluent was sampled. 10/12/2012, 2Q2012, 7/31/2012, by EnviroTrac. The groundwater was sampled on 5/8/2012. DTW 7.88 to 12.05. Flows to northeast. SVE/AS in operation. Monthly SVE/AS system OM&M. The next sampling will be in August 2012. MW-8R, 0.06' LNAPL. MW-2, 8.53J BTEX, 25.4 MTBE. MVE-3, 0.65J BTEX, 32.6 MTBE. MW-7, BTEX ND, 2.6 MTBE. MW-9, 25.61J BTEX, 124 MTBE. MW-3, BTEX ND, 5.6 MTBE.

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104275675 DIST/DIR: 0.015 NE ELEVATION: 18 MAP ID: A7

NAME: HESS STATION 32506

Rev: 08/09/2021

ADDRESS: 126-128 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9405017 / 2016-03-24

ID/Status: 68189

ID/Status: 1994-07-12

SOURCE: NY Department of Environmental Conservation

MVE-2, BTEX ND, 4.2 MTBE. SVE-1, BTEX ND, 4.5 MTBE. MW-5, 14.97J BTEX, 4.0 MTBE. 1/18/2013 - 3Q2012, 10/31/2012, by EnviroTrac. The groundwater was sampled on 8/8/2012. 6/8, 7/31, and 8/8/2012, conducted AS/SVE operation and maintenance. DTW 7.88 to 12.05 bg. Flows to northeast. MW-5, 285.4 BTEX, 1.1 MTBE. MW-9, 16.94J BTEX, 55.1 MTBE. MWV-3, 0.93J BTEX, 12.4 MTBE. MW-2, 3.23J BTEX, 19.6 MTBE. 9/23/2013 - 4Q2012, 1/31/2013, by EnviroTrac. The groundwater was sampled on 11/12/2012. AS/SVE operational. On 9/12, 10/23, 11/12/2012, conducted AS/SVE O&M. DTW 6.29 to 10.25 feet. Flows to northeast. MW-5, 29.37J BTEX, 1.3 MTBE. MW-2, 4.15J BTEX, 15.1 MTBE. MVE-3, 2.75J BTEX, 11.4 MTBE. MW-9, 4.68J BTEX, 31.5 MTBE. 1Q2013, 4/30/2013, by EnviroTrac. The groundwater was sampled on 2/14/2013. SVE/AS operational. On 12/11/2012, 1/16, 2/14/2013, conducted SVE/AS O&M. DTW 7.85 to 11.76 feet. Flows to northeast. MW-5, 20.83J BTEX, 0.72J MTBE. MW-4, BTEX ND, 13.2 MTBE. MW-2, 3.29J BTEX, 11.3 MTBE. MVE-3, 1.42J BTEX, 8.9 MTBE. MW-9, 0.72J BTEX, 17.7 MTBE. 2/25/2014 - Reviewed the Work Plan for Spill Closure 12/6/2013. EnviroTrac proposed to do 11 soil borings for soil sampling. Provided comments. edoc 2/26/2014 - EnviroTrac responded to our comments. Work Plan is approved. eDoc. 11/14/2014 - 2Q2014, 7/31/2014. SVE/AS shutdown 3/19/2013. 5/21/2014, sampled groundwater. DTW 6.92 to 11.44 feet. Flows to northeast. MW-5, 230.6 BTEX. MW-7, 17.6J BTEX, 17.3 MTBE. MW-9, 168.8 BTEX, 75.1 MTBE. 11/17/2014 - 3Q2014, 11/7/2014. 7/10, 8/6 and 8/3/2014, STREs on select wells. 8/19/2014, sampled groundwater. DTW 7.56 to 11.97 feet. Flows to northeast. MW-5, 51.28J BTEX. MVE-3, 25.7 BTEX, 28.4 MTBE. MW-9, 53.61J BTEX. MVE-2, 49.71J BTEX, 10.7 MTBE. SVE-1, 0.06' LNAPL. 1/26/2015 - 4Q2014, 1/26/2015. 11/1/2014, gauged and sampled 12 monitoring wells. DTW 7.39 to 12.53 feet. Flows to northeast. MW-5, 20.32 J BTEX. MVE-3, 23.6 BTEX, 23.9 MTBE. MW-9, 31.88 J BTEX, 57.8 MTBE. MVE-2, 81.83 J BTEX, 10.5 MTBE. 3/24/2016 - Reviewed Spill Closure Request dated 3/2/2015 and spill history. Discussed with Jeff Vought and the spill is closed based on: 1) Sources removal have been done. In 7/1992, (1) 2,000-gallon single wall steel UST and (1) 550-gallon single wall steel UST were removed from the site. During this USTs removal, a total of 46 tons of petroleum impacted soil was excavated and disposed. 2) Another sources removal have been done. In 7/1994, (4) 4,000-gallon steel single wall USTs, (2) 2,000-gallon steel single wall USTs, (36) abandoned 550-gallon steel single wall USTs, and (1) 550-gallon double wall fiberglass wastewater UST were removed from the site. A total of 1,080 tons of petroleum impacted soil was removed. 3) Delineation of soil contamination has been completed. Soil borings/monitoring wells have been installed around the site to delineate soil contamination. The investigations indicated that the soil contamination remain in the former 550-gallon waste water UST area, former (36) abandoned

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104275675 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A7

NAME: HESS STATION 32506

Rev: 08/09/2021

ADDRESS: 126-128 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9405017 / 2016-03-24

ID/Status: 68189

ID/Status: 1994-07-12

SOURCE: NY Department of Environmental Conservation

550-gallon USTs area and the northern portion area adjacent to the canopy area. 4)Delineation of groundwater contamination has been completed. The groundwater flows consistently toward northeast. Downgradient monitoring wells MW-4, MW-5 and MW-6 have shown downward trends in BTEX concentration for years. 5)Product in SVE-1 was last seen on 8/19/2014. Product recovery effort including hand bailing aggressively during site visits according to EnviroTrac email on 4/23/2015. And according to EnviroTrac email 3/2/2016, EnviroTrac has gauged the SVE-1 and found no LNAPL on 10/20/2015. 6)In 11/2006, 60 lbs of ORC was injected into 2 Geoprobe points surrounding MW-5. 7)SVE/AS system has been operational from 11/2011 to 3/2013. The system was shut down due to asymptotic conditions. 8)Confirmatory soil sampling in 5/2014 show remaining soil contamination at the northern portion adjacent to the canopy area, i.e. B-9 at 10-15 feet bgs. Vertical delineation at 25-30 feet indicate no soil contamination. Low groundwater concentration suggested that the remaining soil contamination is no longer impacting the groundwater. 9)As of 4th quarter 2014 monitoring data, overall groundwater concentration has shown low/downward trend in all the wells. The maximum BTEX was detected in MVE-2 with 81.83 J ug/L. 10)The site is still an active gasoline station. No plan to change the use of the site at the time of this spill closure. 11)Inclusion of remaining contamination language in the spill closure letter in case site is redeveloped. Spill is closed. Spill closure letter to Hess/EnviroTrac."

Remarks: "DISCOVERED SOIL IN TANK PULL. SOIL BEING STOCK PILE"

All Materials:

Site ID: 68189

Operable Unit ID: 999295

Operable Unit: 01

Material ID: 381621

Material Code: 0009

Material Name: gasoline

Case No.: Not reported

Material FA: Petroleum

Quantity: -1.00

Units: L

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S104275675 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A7

NAME: HESS STATION 32506

Rev: 08/09/2021

ADDRESS: 126-128 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9205097 / 1994-07-22

ID/Status: 237445

ID/Status: 1992-07-30

SOURCE: NY Department of Environmental Conservation

LTANKS:

Name: 126-128 BRUCKNER/MERIT

Address: 126-128 BRUCKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9205097 / 1994-07-22

Facility ID: 9205097

Site ID: 237445

Spill Date: 1992-07-30

Spill Cause: Tank Failure

Spill Source: Gasoline Station or other PBS Facility

Spill Class: A4

Cleanup Ceased: 1994-07-22

SWIS: 0301

Investigator: SULLIVAN

Referred To: Not reported

Reported to Dept: 1992-08-03

CID: Not reported

Water Affected: Not reported

Spill Notifier: Responsible Party

Last Inspection: Not reported

Recommended Penalty: False

Meets Standard: True

UST Involvement: True

Remediation Phase: 0

Date Entered In Computer: 1992-08-05

Spill Record Last Update: 1994-08-02

Spiller Name: Not reported

Spiller Company: Not reported

Spiller Address: Not reported

Spiller County: 001

Spiller Contact: Not reported

Spiller Phone: Not reported

Spiller Extention: Not reported

DEC Region: 2

DER Facility ID: 195568

DEC Memo: ""

Remarks: "CONTAMINATED SOIL DISCOVERED DURING TANK PULL. WILL STOCKPILE, TEST,
DISPOSE."

All Materials:

Site ID: 237445

Operable Unit ID: 968861

Operable Unit: 01

Material ID: 409327

Material Code: 0009

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S104275675 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A7

NAME: HESS STATION 32506

Rev: 08/09/2021

ADDRESS: 126-128 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9205097 / 1994-07-22
ID/Status: 237445
ID/Status: 1992-07-30

SOURCE: NY Department of Environmental Conservation

Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 08/09/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 1902733 / 2019-06-17
ID/Status: 590668
ID/Status: 2019-06-17

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: 7811 STORE # SPEEDWAY
Address: 126 BRUCKNER BLVD
City,State,Zip: BRONX, NY 10454
Spill Number/Closed Date: 1902733 / 2019-06-17
Facility ID: 1902733
Facility Type: ER
DER Facility ID: 540871
Site ID: 590668
DEC Region: 2
Spill Cause: Equipment Failure
Spill Class: Not reported
SWIS: 0301
Spill Date: 2019-06-17
Investigator: HSSEKHON
Referred To: Not reported
Reported to Dept: 2019-06-17
CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station or other PBS Facility
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2019-06-17
Spill Record Last Update: 2019-06-17
Spiller Name: Not reported
Spiller Company: SPEEDWAY
Spiller Address: Not reported
Spiller Company: 999
Contact Name: ED RUSSO
DEC Memo: "6/17/19 - Sekhon Notifier reported a spill of approx. 7 gallons of gasoline at speedway gas station, due to small hole in the hose associated with dispenser # 8, affecting the station s asphalt surface and a drain located in close proximity to the dispenser. Station attendant spread speedy dry and called environmental company (envirotrac) to respond. EnviroTrac found only a trace amount of gasoline entered the drain. Contractor opened the manway associated with the drain and found that drain had some solid material (dirt/debris) within it, which they shoveled out of the drain. Only minor odors were noted in this material. They swept up speedy dry

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 08/09/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 1902733 / 2019-06-17
ID/Status: 590668
ID/Status: 2019-06-17

SOURCE: NY Department of Environmental Conservation

that station personnel had spread and drummed it along with the material removed from the drain. No impacted material remains in the drain. Site inspected by DEC Sekhon On 6/17/19 (am) - spill was cleaned up to satisfaction. Case closed. "

Remarks: "Small amount less than a gallon went into storm drain/ cleanup is pending"

All Materials:

Site ID: 590668

Operable Unit ID: 1338300

Operable Unit: 01

Material ID: 2347785

Material Code: 0009

Material Name: gasoline

Case No.: Not reported

Material FA: Petroleum

Quantity: 7.00

Units: G

Recovered: Not reported

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

UST:

Name: SPEEDWAY # 7811
Address: 126-128 BRUCKNER BOULEVARD
City,State,Zip: BRONX, NY 10454
Id/Status: 2-297658 / Active
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: 07/30/2023
UTM X: 590989.91095
UTM Y: 4517577.93697
Site Type: Retail Gasoline Sales

Affiliation Records:

Site Id: 13755
Affiliation Type: Facility Operator
Company Name: SPEEDWAY # 7811
Contact Type: Not reported
Contact Name: BRANDIE LEHMAN
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (585) 349-3056
EMail: Not reported
Fax Number: Not reported
Modified By: MASTREIC
Date Last Modified: 2021-01-05

Site Id: 13755
Affiliation Type: Emergency Contact
Company Name: 24 INDIAN HEAD HOLDINGS CORP
Contact Type: Not reported
Contact Name: BRANDIE LEHMAN
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (937) 863-7071
EMail: Not reported
Fax Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Modified By: MASTREIC
Date Last Modified: 2021-01-05

Site Id: 13755
Affiliation Type: Mail Contact
Company Name: SPEEDWAY LLC
Contact Type: MANAGER, ENVIRONMENTAL REMEDIATION
Contact Name: BRANDIE LEHMAN
Address1: 500 SPEEDWAY DR
Address2: Not reported
City: ENON
State: OH
Zip Code: 45323
Country Code: 999
Phone: (937) 863-6624
Email: BKLEHMAN@SPEEDWAY.COM
Fax Number: Not reported
Modified By: MASTREIC
Date Last Modified: 2021-01-05

Site Id: 13755
Affiliation Type: Facility Owner
Company Name: 24 INDIAN HEAD HOLDINGS CORP
Contact Type: MANAGER, ENVIRONMENTAL COMPLIANCE- EAST
Contact Name: BRANDIE LEHMAN
Address1: 24 INDIAN HEAD DR
Address2: Not reported
City: SAYVILLE
State: NY
Zip Code: 11782
Country Code: 001
Phone: (631) 463-1498
Email: Not reported
Fax Number: Not reported
Modified By: MASTREIC
Date Last Modified: 2021-01-05

Tank Info:

Tank Number: 0A9
Tank ID: 15863
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None

Tank Number: 0F8
Tank ID: 15862
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 07/01/1979
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: 0W7

Tank ID: 15861

Tank Status: Closed - Removed

Material Name: Closed - Removed

Capacity Gallons: 2000

Install Date: Not reported

Date Tank Closed: 07/01/1992

Registered: True

Tank Location: Underground

Tank Type: Steel/carbon steel

Material Code: 0001

Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 02

Date Test: 05/01/1991

Next Test Date: Not reported

Pipe Model: Not reported

Modified By: TRANSLAT

Last Modified: 04/14/2017

Equipment Records:

B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H99 - Tank Leak Detection - Other
D10 - Pipe Type - Copper
I01 - Overfill - Float Vent Valve
A00 - Tank Internal Protection - None

Tank Number: 1

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Tank ID: 48322
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 08/01/1994
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: BKFALVEY
Last Modified: 01/02/2019

Equipment Records:

E04 - Piping Secondary Containment - Double walled UG
J02 - Dispenser - Suction Dispenser
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
F04 - Pipe External Protection - Fiberglass
C02 - Pipe Location - Underground/On-ground
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
I02 - Overfill - High Level Alarm
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off
A00 - Tank Internal Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 2
Tank ID: 48323
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 08/01/1994
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Tank Type: Equivalent technology
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: KXLIU
Last Modified: 08/17/2020

Equipment Records:

C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 3
Tank ID: 48324
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 08/01/1994
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 DIST/DIR: 0.015 NE ELEVATION: 18 MAP ID: A8

NAME: SPEEDWAY 7811 Rev: 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Modified By: BKFALVEY
Last Modified: 01/02/2019

Equipment Records:

J01 - Dispenser - Pressurized Dispenser
E04 - Piping Secondary Containment - Double walled UG
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
B04 - Tank External Protection - Fiberglass
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
I03 - Overfill - Automatic Shut-Off
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 37
Tank ID: 15855
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 2000
Install Date: 09/01/1979
Date Tank Closed: 07/01/1994
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 02
Date Test: 09/01/1993
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

B00 - Tank External Protection - None
H99 - Tank Leak Detection - Other
I01 - Overfill - Float Vent Valve
A00 - Tank Internal Protection - None

Tank Number: 38
Tank ID: 15856
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 09/01/1979
Date Tank Closed: 07/01/1994
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 02
Date Test: 09/01/1993
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
H99 - Tank Leak Detection - Other
I01 - Overfill - Float Vent Valve
A00 - Tank Internal Protection - None

Tank Number: 39
Tank ID: 15857
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 09/01/1979
Date Tank Closed: 07/01/1994

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 02
Date Test: 09/01/1993
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H99 - Tank Leak Detection - Other
I01 - Overfill - Float Vent Valve
A00 - Tank Internal Protection - None

Tank Number: 4
Tank ID: 48325
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 08/01/1994
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: KXLIU
Last Modified: 08/17/2020

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Equipment Records:

J01 - Dispenser - Pressurized Dispenser
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
B04 - Tank External Protection - Fiberglass
E04 - Piping Secondary Containment - Double walled UG
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
I03 - Overfill - Automatic Shut-Off
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 40

Tank ID: 15858

Tank Status: Closed - Removed

Material Name: Closed - Removed

Capacity Gallons: 4000

Install Date: 09/01/1979

Date Tank Closed: 07/01/1994

Registered: True

Tank Location: Underground

Tank Type: Steel/carbon steel

Material Code: 0009

Common Name of Substance: Gasoline

Tightness Test Method: 02

Date Test: 09/01/1993

Next Test Date: Not reported

Pipe Model: Not reported

Modified By: TRANSLAT

Last Modified: 04/14/2017

Equipment Records:

D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H99 - Tank Leak Detection - Other

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

I01 - Overfill - Float Vent Valve
A00 - Tank Internal Protection - None

Tank Number: 41
Tank ID: 15859
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 2000
Install Date: 09/01/1979
Date Tank Closed: 07/01/1994
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 02
Date Test: 09/01/1993
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H99 - Tank Leak Detection - Other
I01 - Overfill - Float Vent Valve
A00 - Tank Internal Protection - None

Tank Number: 42
Tank ID: 15860
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 09/01/1979
Date Tank Closed: 07/01/1994
Registered: True
Tank Location: Underground

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 02
Date Test: 09/01/1993
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H99 - Tank Leak Detection - Other
I01 - Overfill - Float Vent Valve
A00 - Tank Internal Protection - None

Tank Number: 45
Tank ID: 45682
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: 07/01/1992
Date Tank Closed: 07/01/1994
Registered: True
Tank Location: Underground
Tank Type: Fiberglass coated steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: 09
Date Test: 02/01/1995
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 DIST/DIR: 0.015 NE ELEVATION: 18 MAP ID: A8

NAME: SPEEDWAY 7811 Rev: 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

K01 - Spill Prevention - Catch Basin
B04 - Tank External Protection - Fiberglass
H99 - Tank Leak Detection - Other
D00 - Pipe Type - No Piping
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I01 - Overfill - Float Vent Valve
A00 - Tank Internal Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 5
Tank ID: 48326
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 08/01/1994
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: BKFALVEY
Last Modified: 01/02/2019

Equipment Records:
J02 - Dispenser - Suction Dispenser
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
B04 - Tank External Protection - Fiberglass
E04 - Piping Secondary Containment - Double walled UG
I03 - Overfill - Automatic Shut-Off
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tank Number: 6
Tank ID: 49599
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 600
Install Date: 08/01/1994
Date Tank Closed: 12/01/2010
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: 09
Date Test: 02/01/1995
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: NRLOMBAR
Last Modified: 04/14/2017

Equipment Records:
E00 - Piping Secondary Containment - None
I02 - Overfill - High Level Alarm
B04 - Tank External Protection - Fiberglass
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
J00 - Dispenser - None
L00 - Piping Leak Detection - None
D00 - Pipe Type - No Piping
I03 - Overfill - Automatic Shut-Off
K00 - Spill Prevention - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: A10
Tank ID: 15864
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: A11
Tank ID: 15865
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: A12
Tank ID: 15866
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A13
Tank ID: 15867
Tank Status: Closed - In Place
Material Name: Closed - In Place

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: A14
Tank ID: 15868
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A15
Tank ID: 15869
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tank Number: A16
Tank ID: 15870
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: A17
Tank ID: 15871
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A18
Tank ID: 15872
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A19
Tank ID: 15873
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: A20
Tank ID: 15874
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A21
Tank ID: 15875
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
G00 - Tank Secondary Containment - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None

Tank Number: A22
Tank ID: 15876
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: A23
Tank ID: 15877
Tank Status: Closed - In Place

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None

Tank Number: A24
Tank ID: 15878
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A25
Tank ID: 15879
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tank Number: A26
Tank ID: 15880
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A27
Tank ID: 15881
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 DIST/DIR: 0.015 NE ELEVATION: 18 MAP ID: A8

NAME: SPEEDWAY 7811 Rev: 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: A28
Tank ID: 15882
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

F00 - Pipe External Protection - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A29
Tank ID: 15883
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A30
Tank ID: 15884
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: A31
Tank ID: 15885
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
G00 - Tank Secondary Containment - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A32
Tank ID: 15886
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A33
Tank ID: 15887
Tank Status: Closed - In Place

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None

Tank Number: A34
Tank ID: 15888
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A35
Tank ID: 15889
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tank Number: A36
Tank ID: 15890
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: A37
Tank ID: 15891
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A38
Tank ID: 15892
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

F00 - Pipe External Protection - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A39
Tank ID: 15893
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: A40
Tank ID: 15894
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A41
Tank ID: 15895
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A42
Tank ID: 15896
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A43
Tank ID: 15897
Tank Status: Closed - In Place

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811 **Rev:** 06/21/2021
ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/01/1979
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: A44
Tank ID: 15898
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 07/01/1992
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 06/21/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
H99 - Tank Leak Detection - Other
D00 - Pipe Type - No Piping
I01 - Overfill - Float Vent Valve
A00 - Tank Internal Protection - None

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-VSQG

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 09/13/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYD982185605

SOURCE: US Environmental Protection Agency

RCRA-VSQG:

Date Form Received by Agency: 20160921

Handler Name: SPEEDWAY 7811

Handler Address: 126 BRUCKNER BLVD

Handler City,State,Zip: BRONX, NY 10454-4620

EPA ID: NYD982185605

Contact Name: CHARLES A BESSE

Contact Address: PO BOX 1500

Contact City,State,Zip: SPRINGFIELD, OH 45501-1500

Contact Telephone: 937-863-6272

Contact Fax: 937-863-6078

Contact Email: CABESSE@SPEEDWAY.COM

Contact Title: ENVIRONMENTAL COMPLIANCE ADMIN

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Handler Activities

State District Owner: NY

State District: NYSDEC R2

Mailing Address: PO BOX 1500

Mailing City,State,Zip: SPRINGFIELD, OH 45501-1500

Owner Name: MERIT OIL CORP

Owner Type: Private

Operator Name: MERIT OIL CORP

Operator Type: Private

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-VSQG

EDR ID: 1000263767	DIST/DIR: 0.015 NE	ELEVATION: 18	MAP ID: A8

NAME: SPEEDWAY 7811

Rev: 09/13/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYD982185605

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20161013
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Hazardous Waste Summary:

Waste Code: D001

Waste Description: IGNITABLE WASTE

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-VSQG

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 09/13/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYD982185605

SOURCE: US Environmental Protection Agency

Waste Code: D018

Waste Description: BENZENE

Handler - Owner Operator:

Owner/Operator Indicator: Owner

Owner/Operator Name: MERIT OIL CORP

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: NOT REQUIRED

Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999

Owner/Operator Telephone: 212-555-1212

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: SPEEDWAY LLC

Legal Status: Private

Date Became Current: 20141001

Date Ended Current: Not reported

Owner/Operator Address: PO BOX 1500

Owner/Operator City,State,Zip: SPRINGFIELD, OH 45501-1500

Owner/Operator Telephone: 937-864-3000

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: MERIT OIL CORP

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: NOT REQUIRED

Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999

Owner/Operator Telephone: 212-555-1212

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: MERIT OIL CORP

Legal Status: Private

Date Became Current: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-VSQG

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 09/13/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYD982185605

SOURCE: US Environmental Protection Agency

Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: MERIT OIL CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: MERIT OIL CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SPEEDWAY LLC
Legal Status: Private
Date Became Current: 20141001
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-VSQG

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 09/13/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYD982185605

SOURCE: US Environmental Protection Agency

Historic Generators:

Receive Date: 19990708

Handler Name: MERIT OIL CORP

Federal Waste Generator Description: Not a generator, verified

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

Receive Date: 20060101

Handler Name: MERIT OIL CORP

Federal Waste Generator Description: Not a generator, verified

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

Receive Date: 20070101

Handler Name: MERIT OIL CORP

Federal Waste Generator Description: Not a generator, verified

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

Receive Date: 19870511

Handler Name: MERIT OIL CORP

Federal Waste Generator Description: Large Quantity Generator

State District Owner: NY

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-VSQG

EDR ID: 1000263767 **DIST/DIR:** 0.015 NE **ELEVATION:** 18 **MAP ID:** A8

NAME: SPEEDWAY 7811

Rev: 09/13/2021

ADDRESS: 126 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYD982185605

SOURCE: US Environmental Protection Agency

Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20160921
Handler Name: SPEEDWAY 7811
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 447110
NAICS Description: GASOLINE STATIONS WITH CONVENIENCE STORES

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104194774 **DIST/DIR:** 0.016 South **ELEVATION:** 19 **MAP ID:** 9

NAME: MANHOLE 5962

Rev: 08/09/2021

ADDRESS: IFO 550 E 132ND ST
BRONX, NY
BRONX

ID/Status: 9906764 / 1999-12-14
ID/Status: 131518
ID/Status: 1999-09-07

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 5962

Address: IFO 550 E 132ND ST

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9906764 / 1999-12-14

Facility ID: 9906764

Facility Type: ER

DER Facility ID: 113310

Site ID: 131518

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 1999-09-07

Investigator: CAENGELH

Referred To: Not reported

Reported to Dept: 1999-09-07

CID: 388

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1999-09-07

Spill Record Last Update: 2000-05-24

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: CALLER

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

ENGELHARDT Con ed e2mis notes: 1 gal on unknown oil and 1000 gallons
of water, clean up will be schedule when results are received.

According to conduit plate 3-C there is no sewer connection. 1 pt oil
and approx 800 gal water removed from structure...used 420 lbs of
solid waste generated... tag removed. "

Remarks: "CALLER REPORTS 1 GALLON UNKNOWN ON 100 GALLONS OF WATER IN MANHOLE.
CONED#127627. CLEANUP PENDING TEST RESULTS."

All Materials:

Site ID: 131518

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104194774 **DIST/DIR:** 0.016 South **ELEVATION:** 19 **MAP ID:** 9

NAME: MANHOLE 5962

Rev: 08/09/2021

ADDRESS: IFO 550 E 132ND ST
BRONX, NY
BRONX

ID/Status: 9906764 / 1999-12-14
ID/Status: 131518
ID/Status: 1999-09-07

SOURCE: NY Department of Environmental Conservation

Operable Unit ID: 1085201
Operable Unit: 01
Material ID: 299488
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103938297 **DIST/DIR:** 0.022 West **ELEVATION:** 19 **MAP ID:** B10

NAME: MANHOLE 6017

Rev: 08/09/2021

ADDRESS: BROOKE AVE/E 132 ST
BRONX, NY
BRONX

ID/Status: 9902868 / 2003-06-25

ID/Status: 212693

ID/Status: 1999-06-12

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 6017

Address: BROOKE AVE/E 132 ST

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9902868 / 2003-06-25

Facility ID: 9902868

Facility Type: ER

DER Facility ID: 176206

Site ID: 212693

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 1999-06-12

Investigator: CAENGELH

Referred To: Not reported

Reported to Dept: 1999-06-12

CID: 207

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1999-06-12

Spill Record Last Update: 2003-06-26

Spiller Name: FRANK MASSERIA

Spiller Company: CON ED

Spiller Address: 4 IRVING PLACE

Spiller Company: 001

Contact Name: RICHARD ROACH

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
ENGELHARDT e2mis no. 125-526: D SIMON FOD SUPV RPTS CABLE OIL FROM
BLOWN JOINT IN MH6017 OPP SEC E132 ST & BROOK AVE..APPROX 1 OZ IN DRY
HOLE..THER IS NO SEWER CONNECTION..NO WATERWAYS AFFECTED...WILL
ASSUME 50-499 PPM FOR CLEANUP PURPOSES...NO TAG HUNG BECAUSE CLEANUP
CREW IS ON LOCATION. CLEANUP COMPLETE 0235 HRS. 5 GAL DRUM WITH
LEAD/PCB WASTE LEFT IN MH FOR PICKUP IN AM. 06/12/99 0900 DRUM PICK
UP & TAG REMOVED. 27-JAN-2003 09:56 As per field inspection performed
on 1/21/03, blown joint was replaced."

Remarks: "1 OUNCE OF PRODUCT - CLEANED UP CON ED 125526 50-99 PCB'S "

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103938297 **DIST/DIR:** 0.022 West **ELEVATION:** 19 **MAP ID:** B10

NAME: MANHOLE 6017

Rev: 08/09/2021

ADDRESS: BROOKE AVE/E 132 ST
BRONX, NY
BRONX

ID/Status: 9902868 / 2003-06-25
ID/Status: 212693
ID/Status: 1999-06-12

SOURCE: NY Department of Environmental Conservation

All Materials:

Site ID: 212693
Operable Unit ID: 1077476
Operable Unit: 01
Material ID: 302799
Material Code: 0541A
Material Name: dielectric fluid
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: 1.00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

BROWNFIELDS

EDR ID: S125896289 **DIST/DIR:** 0.023 East **ELEVATION:** 18 **MAP ID:** C11

NAME: 138 BRUCKNER BOULEVARD **Rev:** 08/09/2021
ADDRESS: 138 BRUCKNER BOULEVARD / 107 SAINT ANN'S AVENUE ID/Status: 595017
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

BROWNFIELDS:

Name: 138 BRUCKNER BOULEVARD
Address: 138 BRUCKNER BOULEVARD / 107 SAINT ANN'S AVENUE
City,State,Zip: BRONX, NY 10454
Program: BCP
Site Code: 595017
Acres: 1.160
HW Code: C203127
SWIS: 0301
Town: New York City
Record Added Date: 10/08/2019
Record Updated Date: 01/21/2021
Update By: HMDUDEK
Site Description: "Location The Site is located at 138 Bruckner Boulevard (Lot 10) and 107 Saint Ann s Avenue (Lot 19) in the Mott Haven section of the Bronx, New York. The Site is bound to the north by Bruckner Boulevard and two multi-family residential buildings, followed by a sheet metal supply warehouse and storage yard, and mixed residential and commercial uses; to the east by St. Ann s Avenue, followed by a warehouse and showroom; to the south by East 132nd Street, followed by a food depot warehouse; and to the west by a gasoline station and an iron works. Site Features The Site consists of two tax lots on an approximately 1.16-acre parcel. A bakery operates both lots. Lot 10 contains a one- to two-story warehouse occupied by a bakery and production and distribution facility. Lot 19 contains an asphalt-paved parking lot for employees of the bakery. Current Zoning and Land Use The current zoning designation of the Site is M1-5/R8A (manufacturing/residential), and is located within Special Mixed Use District MX-1 (Port Morris). The surrounding area is largely developed with industrial and commercial uses with residential uses located further north. A zoning map is provided as Figure 6. Past Use of the Site Based on the historical Sanborn Fire Insurance Maps and City Directories, the Site was vacant up until approximately 1908, when Lot 10 was developed with several low-rise dwellings. The existing warehouse on Lot 19 was constructed by 1935 and initially occupied by Vess Dry Bottling Co. on the western side of the building and Fireproof Products Co. on the eastern side. North Eastern Bag & Burlap Co. was additionally identified in the western portion of the building between 1940 and 1947. Fireproof Products Co. occupied the entire warehouse by 1951 and until approximately 1968. Lot 19 became vacant by 1986. It is unknown whether any of the historic operations included manufacturing. Operations by the current building occupant, a bakery, reportedly began in 1993. Site Geology and Hydrology Based on reports compiled by the U.S. Geological Survey Central Park

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

BROWNFIELDS

EDR ID: S125896289 **DIST/DIR:** 0.023 East **ELEVATION:** 18 **MAP ID:** C11

NAME: 138 BRUCKNER BOULEVARD **Rev:** 08/09/2021
ADDRESS: 138 BRUCKNER BOULEVARD / 107 SAINT ANN'S AVENUE ID/Status: 595017
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Quadrangle map, the Site lies at an elevation of approximately 15 to 20 feet above mean sea level and slopes slightly down toward the south to southwest. Groundwater is expected to flow in a southerly to southwesterly direction toward the Bronx Kill (a tributary of the Harlem River), located approximately 600 feet southwest of the Site. Subsurface materials beneath the concrete slab in Lot 10 consist of historical fill (predominantly sand with gravel, brick, and silt) down to the maximum boring termination depth of 6 feet below the concrete slab. Groundwater is anticipated to be approximately 8 to 12 feet below grade. "

Env Problem: "Information submitted with the BCP application regarding the environmental condition at the site are currently under review and will be revised as additional information becomes available."

Health Problem: "Information submitted with the BCP application regarding the conditions at the site are currently under review and will be revised as additional information becomes available."

Dump: False

Structure: False

Lagoon: False

Landfill: False

Pond: False

Disp Start: Not reported

Disp Term: Not reported

Lat/Long: Not reported

Dell: Not reported

Record Add: 2020-01-24 11:04:00

Record Upd: 2020-01-24 11:04:00

Updated By: GWBURKE

Own Op: 1

Sub Type: E

Owner Name: Michael Zaro

Owner Company: Anjost Corporation

Owner Address: 138 Bruckner Boulevard

Owner Addr2: Not reported

Owner City,St,Zip: Bronx, NY 10454

Owner Country: United States of America

Own Op: 6

Sub Type: P03

Owner Name: Evan Kashanian

Owner Company: 138 Bruckner Owner LLC

Owner Address: 316 West 118th Street, Floor 4

Owner Addr2: Not reported

Owner City,St,Zip: New York, NY 10026

Owner Country: United States of America

Own Op: Document Repository

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

BROWNFIELDS

EDR ID: S125896289 **DIST/DIR:** 0.023 East **ELEVATION:** 18 **MAP ID:** C11

NAME: 138 BRUCKNER BOULEVARD **Rev:** 08/09/2021
ADDRESS: 138 BRUCKNER BOULEVARD / 107 SAINT ANN'S AVENUE ID/Status: 595017
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Sub Type: NNN
Owner Name: Jeanine Cross
Owner Company: Mott Haven Library
Owner Address: 321 East 140th Street
Owner Addr2: Not reported
Owner City,St,Zip: Bronx, NY 10454
Owner Country: United States of America
Own Op: 4
Sub Type: E
Owner Name: Michael Zaro
Owner Company: Zaro's Family Bakery
Owner Address: 138 Bruckner Boulevard
Owner Addr2: Not reported
Owner City,St,Zip: Bronx, NY 10454
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Cedric L. Loftin
Owner Company: Bronx Community Board 1
Owner Address: 3024 Third Avenue
Owner Addr2: Not reported
Owner City,St,Zip: Bronx, NY 10455
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Michael Zaro
Owner Company: 138 Bruckner Blvd. Associates, LLC
Owner Address: 138 Bruckner Boulevard
Owner Addr2: Not reported
Owner City,St,Zip: Bronx, NY 10454
Owner Country: United States of America
HW Code: Not reported
Waste Type: Not reported
Waste Quantity: Not reported
Waste Code: Not reported
Crossref ID: 9804809
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2019-10-08 13:41:00
Record Updated: 2019-10-08 13:41:00
Updated By: AMSERVIS

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: U001838850 **DIST/DIR:** 0.023 East **ELEVATION:** 18 **MAP ID:** C12

NAME: ZARO BAKE SHOP INC

Rev: 08/09/2021

ADDRESS: 138 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

ID/Status: 9804809 / 2003-11-17

ID/Status: 322371

ID/Status: 1998-07-17

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: BUSINESS

Address: 138 BRUCKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9804809 / 2003-11-17

Facility ID: 9804809

Facility Type: ER

DER Facility ID: 259702

Site ID: 322371

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: D4

SWIS: 0301

Spill Date: 1998-07-17

Investigator: JXZHAO

Referred To: Not reported

Reported to Dept: 1998-07-17

CID: 370

Water Affected: Not reported

Spill Source: Commercial Vehicle

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1998-07-17

Spill Record Last Update: 2003-11-17

Spiller Name: Not reported

Spiller Company: MYSTIC TRANSPORT

Spiller Address: 19-01 STEINWAY ST

Spiller Company: 001

Contact Name: ABOVE CALLER

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
ZHAO "

Remarks: "guage malfunction on tank - spill out of vent to concrete - spill
contained and cleanup crew enroute"

All Materials:

Site ID: 322371

Operable Unit ID: 1065854

Operable Unit: 01

Material ID: 319576

Material Code: 0001A

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	U001838850	DIST/DIR:	0.023 East	ELEVATION:	18	MAP ID:	C12

NAME: ZARO BAKE SHOP INC

Rev: 08/09/2021

ADDRESS: 138 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

ID/Status: 9804809 / 2003-11-17
ID/Status: 322371
ID/Status: 1998-07-17

SOURCE: NY Department of Environmental Conservation

Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 5.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U001838850 **DIST/DIR:** 0.023 East **ELEVATION:** 18 **MAP ID:** C12

NAME: ZARO BAKE SHOP INC **Rev:** 06/21/2021
ADDRESS: 138 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

UST:
Name: ZARO BAKE SHOP INC
Address: 138 BRUCKNER BOULEVARD
City,State,Zip: BRONX, NY 10454
Id/Status: 2-007641 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: N/A
UTM X: 591067.81597
UTM Y: 4517559.32509
Site Type: Manufacturing (Other than Chemical)/Processing

Affiliation Records:
Site Id: 70
Affiliation Type: Facility Owner
Company Name: ANJOST CORP.
Contact Type: Not reported
Contact Name: Not reported
Address1: 138 BRUCKNER BLVD
Address2: Not reported
City: BRONX
State: NY
Zip Code: 10454
Country Code: 001
Phone: (718) 993-5600
EMail: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 2013-07-02

Site Id: 70
Affiliation Type: Mail Contact
Company Name: ZARO BAKE SHOP INC
Contact Type: Not reported
Contact Name: MR. RALPH BEN SHALOM
Address1: 138 BRUCKNER BOULEVARD
Address2: Not reported
City: BRONX
State: NY
Zip Code: 10454
Country Code: 001
Phone: (718) 993-5600
EMail: LMARCO@ZARO.COM
Fax Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U001838850 **DIST/DIR:** 0.023 East **ELEVATION:** 18 **MAP ID:** C12

NAME: ZARO BAKE SHOP INC **Rev:** 06/21/2021
ADDRESS: 138 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Modified By: NRLOMBAR
Date Last Modified: 2013-07-02

Site Id: 70
Affiliation Type: Facility Operator
Company Name: ZARO BAKE SHOP INC
Contact Type: Not reported
Contact Name: ZARO BAKE SHOP INC
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (212) 993-5600
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 70
Affiliation Type: Emergency Contact
Company Name: ZARO BAKE SHOP INC
Contact Type: Not reported
Contact Name: RALPH BEN SHALOM
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (212) 261-8247
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 001
Tank ID: 26837
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 3000

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U001838850 **DIST/DIR:** 0.023 East **ELEVATION:** 18 **MAP ID:** C12

NAME: ZARO BAKE SHOP INC

Rev: 06/21/2021

ADDRESS: 138 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Install Date: 01/01/1982
Date Tank Closed: 06/07/2013
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 21
Date Test: 07/22/2008
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: NROLMBAR
Last Modified: 04/14/2017

Equipment Records:

C01 - Pipe Location - Aboveground
I04 - Overfill - Product Level Gauge (A/G)
A01 - Tank Internal Protection - Epoxy Liner
L09 - Piping Leak Detection - Exempt Suction Piping
D02 - Pipe Type - Galvanized Steel
H04 - Tank Leak Detection - Groundwater Well
J02 - Dispenser - Suction Dispenser
G07 - Tank Secondary Containment - Excavation Liner
B01 - Tank External Protection - Painted/Asphalt Coating
F99 - Pipe External Protection - Other

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280289 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B13

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BROOK AVE & 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP004751616

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150316

Handler Name: CON EDISON

Handler Address: BROOK AVE & 132ND ST

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004751616

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL, 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280289 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B13

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BROOK AVE & 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP004751616

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160502
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Biennial: List of Years
Year: 2015

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280289 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B13

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BROOK AVE & 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP004751616

SOURCE: US Environmental Protection Agency

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code: D008

Waste Description: LEAD

Handler - Owner Operator:

Owner/Operator Indicator: Operator

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20150316

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20150316

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20160205

Handler Name: CON EDISON - MANHOLE 6016

Federal Waste Generator Description: Large Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280289 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B13

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BROOK AVE & 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP004751616

SOURCE: US Environmental Protection Agency

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150316
Handler Name: CON EDISON
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150316
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 221122
NAICS Description: ELECTRIC POWER DISTRIBUTION

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S121099997 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B14

NAME: IN CONTAINMENT

Rev: 08/09/2021

ADDRESS: BROOK AVE AND 132ND
BRONX, NY
BRONX

ID/Status: 1702982 / 2017-06-26

ID/Status: 553135

ID/Status: 2017-06-26

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: IN CONTAINMENT

Address: BROOK AVE AND 132ND

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 1702982 / 2017-06-26

Facility ID: 1702982

Facility Type: ER

DER Facility ID: 506747

Site ID: 553135

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 2017-06-26

Investigator: TJDEMEO

Referred To: Not reported

Reported to Dept: 2017-06-26

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial Vehicle

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2017-06-26

Spill Record Last Update: 2017-06-26

Spiller Name: Not reported

Spiller Company: CRUZ CONTRACTING

Spiller Address: Not reported

Spiller Company: 999

Contact Name: NAIDIE ERICSON

DEC Memo: "6/26/17 TJD Teleconference with Naidie Ericson at McMillen Jacob

Associates - they are a contractor working for NYCDDC on a water/gas

main extension project for Randalls Island. Spill is maximum of 2

gallons of hydraulic oil spilled from failed hose on excavator. Spill

is actually inside a water filled vertical shaft. Contractor skimming

oily water for disposal. No discharge exterior to 3 ft diameter

sealed shaft. Spill closed."

Remarks: "spill is contained and clean up is pending"

All Materials:

Site ID: 553135

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S121099997 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B14

NAME: IN CONTAINMENT

Rev: 08/09/2021

ADDRESS: BROOK AVE AND 132ND
BRONX, NY
BRONX

ID/Status: 1702982 / 2017-06-26
ID/Status: 553135
ID/Status: 2017-06-26

SOURCE: NY Department of Environmental Conservation

Operable Unit ID: 1301221
Operable Unit: 01
Material ID: 2307586
Material Code: 0010
Material Name: hydraulic oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 2.00
Units: G
Recovered: Not reported
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010326104	DIST/DIR: 0.023 West	ELEVATION: 19	MAP ID: B15

NAME: CON EDISON MANHOLE 6016

Rev: 09/13/2021

ADDRESS: BROOK AVE & E 132 ST
BRONX, NY 10453
BRONX

ID/Status: NYP004139176

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20060707
 Handler Name: CON EDISON MANHOLE 6016
 Handler Address: BROOK AVE & E 132 ST
 Handler City,State,Zip: BRONX, NY 10453
 EPA ID: NYP004139176
 Contact Name: MICHAEL DAUGHTREY
 Contact Address: 4 IRVING PL, RM 828
 Contact City,State,Zip: NEW YORK, NY 10003
 Contact Telephone: 212-580-8383
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Not reported
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R2
 Mailing Address: 4 IRVING PL, RM 828
 Mailing City,State,Zip: NEW YORK, NY 10003
 Owner Name: Not reported
 Owner Type: Not reported
 Operator Name: Not reported
 Operator Type: Not reported
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010326104	DIST/DIR: 0.023 West	ELEVATION: 19	MAP ID: B15

NAME: CON EDISON MANHOLE 6016

Rev: 09/13/2021

ADDRESS: BROOK AVE & E 132 ST
BRONX, NY 10453
BRONX

ID/Status: NYP004139176

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20060705
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010326104 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B15

NAME: CON EDISON MANHOLE 6016

Rev: 09/13/2021

ADDRESS: BROOK AVE & E 132 ST
BRONX, NY 10453
BRONX

ID/Status: NYP004139176

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Not reported
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060706
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060707
Handler Name: CON EDISON MANHOLE 6016
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010326104 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B15

NAME: CON EDISON MANHOLE 6016

Rev: 09/13/2021

ADDRESS: BROOK AVE & E 132 ST
BRONX, NY 10453
BRONX

ID/Status: NYP004139176

SOURCE: US Environmental Protection Agency

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103938973 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B16

NAME: MANHOLE 6071

Rev: 08/09/2021

ADDRESS: BROOK AVE & EAST 132ND ST
BRONX, NY
BRONX

ID/Status: 9903621 / 2002-04-15

ID/Status: 267145

ID/Status: 1999-06-29

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 6071

Address: BROOK AVE & EAST 132ND ST

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9903621 / 2002-04-15

Facility ID: 9903621

Facility Type: ER

DER Facility ID: 217624

Site ID: 267145

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 1999-06-29

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 1999-06-29

CID: 388

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1999-06-29

Spill Record Last Update: 2002-04-15

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: CALLER

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
O'CONNELL e2mis no. 125-882: JUNE 29, 1999 FOD FOUND CABLE LEAKING
OIL IN MH-6017. CREW REPORTS APPROX 10 oz OF OIL IN MH. OIL IS IN TWO
SPOTS. OIL IS CONTAINED AND HAS NOT ENTERED ANY SEWER OR WATERWAY.
THERE IS NO WATER IN MH. CLEAN-UP IS IN PROGRESS AND WILL BE TREATED
AS 50 - 499 ppm. JUNE 29, 1999 SUPV J. KOFOED #80850 REPORTS CLEAN UP
COMPLETED. CABLE ENDS WHERE LEAK WAS COMING FROM HAS BE SEALED. EPA
ID # NYP 004 039 442 RECIEVED FOR HOLE"

Remarks: "CALLER REPORTS UNKNOWNSOURCE. CLEANUP IN PROGRESS TREATING AS 50-499
PPM CON ED 125882."

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103938973 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B16

NAME: MANHOLE 6071

Rev: 08/09/2021

ADDRESS: BROOK AVE & EAST 132ND ST
BRONX, NY
BRONX

ID/Status: 9903621 / 2002-04-15
ID/Status: 267145
ID/Status: 1999-06-29

SOURCE: NY Department of Environmental Conservation

All Materials:

Site ID: 267145
Operable Unit ID: 1078214
Operable Unit: 01
Material ID: 303533
Material Code: 0541A
Material Name: dielectric fluid
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901958	DIST/DIR: 0.023 West	ELEVATION: 19	MAP ID: B17

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004767927

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150414

Handler Name: CON EDISON

Handler Address: E 132ND ST & BROOK AVE

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004767927

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901958 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B17

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004767927

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDs Where RCRA CA has Been Imposed Universe: No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSD Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150414
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901958 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B17

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004767927

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150414
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901959 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B18

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004767935

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150414

Handler Name: CON EDISON

Handler Address: E 132ND ST & BROOK AVE

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004767935

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901959 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B18

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004767935

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150414
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901959 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B18

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004767935

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150414
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901957 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B19

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004767919

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150414

Handler Name: CON EDISON

Handler Address: E 132ND ST & BROOK AVE

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004767919

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901957 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B19

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004767919

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150414
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901957 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B19

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004767919

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150414
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104194771 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B20

NAME: MANHOLE 6017

Rev: 08/09/2021

ADDRESS: 132ND ST & BROOK AVE
BRONX, NY
BRONX

ID/Status: 9906759 / 1999-11-09

ID/Status: 75228

ID/Status: 1999-09-07

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 6017

Address: 132ND ST & BROOK AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9906759 / 1999-11-09

Facility ID: 9906759

Facility Type: ER

DER Facility ID: 70442

Site ID: 75228

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 1999-09-07

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 1999-09-07

CID: 388

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1999-09-07

Spill Record Last Update: 2000-05-24

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: CALLER

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL con ed e2mis notes: 2 pint oil on 5 gallons water in MH

6017 opp. Sample taken. Plate 3C indicates no sewer connection.

Sample results recieved..Oppm no aroclor.. sez number 99-09291 Job
complete, tag pulled. "

Remarks: "CALLER REPORTS 2 PINT UNKNOWN IN MANHOLE. CON ED #127625. SAMPLE
TAKEN CLEANUP PENDING RESULTS. 5 GALLON OF WATER IN MANHOLE."

All Materials:

Site ID: 75228

Operable Unit ID: 1085193

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104194771 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B20

NAME: MANHOLE 6017

Rev: 08/09/2021

ADDRESS: 132ND ST & BROOK AVE
BRONX, NY
BRONX

ID/Status: 9906759 / 1999-11-09
ID/Status: 75228
ID/Status: 1999-09-07

SOURCE: NY Department of Environmental Conservation

Operable Unit: 01
Material ID: 299483
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S121098901 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B21

NAME: PAVEMENT

Rev: 08/09/2021

ADDRESS: BROOK AVE AND EAST 132ND
BRONX, NY
BRONX

ID/Status: 1701616 / 2017-05-19

ID/Status: 548688

ID/Status: 2017-05-19

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: PAVEMENT

Address: BROOK AVE AND EAST 132ND

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 1701616 / 2017-05-19

Facility ID: 1701616

Facility Type: ER

DER Facility ID: 502317

Site ID: 548688

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 2017-05-19

Investigator: TJDEMEO

Referred To: Not reported

Reported to Dept: 2017-05-19

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial Vehicle

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2017-05-19

Spill Record Last Update: 2017-05-19

Spiller Name: ED

Spiller Company: CRUZ LLC

Spiller Address: BROOK AVE AND EAST 132ND

Spiller Company: 999

Contact Name: ED

DEC Memo: "5/19/17 TJD Teleconference with Ed from NYCDDC. Roll-off truck blew a hydraulic hose. NYCDDC contacted NYCDOS to sand roadway - completed. NYCDDC is contracting with a private vendor to sweep and recover sand and granular absorbents. Involved truck is on DDC property with containment under truck. Leak has been stopped. Truck out of service pending repairs. No drainage impacts due to reported release. Spill closed."

Remarks: "Line broke clean up is started"

All Materials:

Site ID: 548688

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S121098901 **DIST/DIR:** 0.023 West **ELEVATION:** 19 **MAP ID:** B21

NAME: PAVEMENT

Rev: 08/09/2021

ADDRESS: BROOK AVE AND EAST 132ND
BRONX, NY
BRONX

ID/Status: 1701616 / 2017-05-19

ID/Status: 548688

ID/Status: 2017-05-19

SOURCE: NY Department of Environmental Conservation

Operable Unit ID: 1296815

Operable Unit: 01

Material ID: 2302930

Material Code: 0010

Material Name: hydraulic oil

Case No.: Not reported

Material FA: Petroleum

Quantity: 6.00

Units: G

Recovered: Not reported

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103573385 **DIST/DIR:** 0.029 North **ELEVATION:** 18 **MAP ID:** D22

NAME: IN MANHOLE 23757

Rev: 08/09/2021

ADDRESS: E 132 ST/UNDER THE KILLS
BRONX, NY
BRONX

ID/Status: 9809257 / 2002-10-31
ID/Status: 325044
ID/Status: 1998-10-24

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: IN MANHOLE 23757

Address: E 132 ST/UNDER THE KILLS

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9809257 / 2002-10-31

Facility ID: 9809257

Facility Type: ER

DER Facility ID: 261838

Site ID: 325044

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 1998-10-24

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 1998-10-24

CID: 297

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1998-10-24

Spill Record Last Update: 2002-10-31

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: JOE DEVOTI

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
O'CONNELL Con Ed e2mis #120776: October 24,1998 02: 35 FIELD OPERATOR
R. DAILEY #55123 FOUND ABOUT 2 GALS OF OIL IN MH23757 WHILE LOOKING
FOR A FAULT ON FEEDER 3M44. THERE IS NO WATER WAYS OR SEWERS
AFFECTED. THE OIL IS CONTAINED IN THE MH. TAG 20183 WAS HUNG. TANKER
TO BE ORDERED. 0307 CALLED TRANS. FOR TANKER . NONE AVAILABLE DUE TO
NO DRIVERS. 25 OCT 1998 20: 00 THIS JOB WAS SUSPENDED . THEIR IS NO
RELIEF FOR THE TANKER DRIVER. THE DRIVER HAS TO BE BACK AT ASTORIA BY
21:30. A VACTOR TANKER WAS ORDERED FOR THE FIRST THING IN THE AM.
OCT. 26,1998 14:24 CLEAN UP COMPLETE AT 13:50 AND TAG #20183 WAS

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103573385 **DIST/DIR:** 0.029 North **ELEVATION:** 18 **MAP ID:** D22

NAME: IN MANHOLE 23757

Rev: 08/09/2021

ADDRESS: E 132 ST/UNDER THE KILLS
BRONX, NY
BRONX

ID/Status: 9809257 / 2002-10-31

ID/Status: 325044

ID/Status: 1998-10-24

SOURCE: NY Department of Environmental Conservation

PULLED."

Remarks: "CON ED WORKERS FOUND A WATER/OIL MIXTURE IN A MANHOLE WHILE WORKING
/ CON ED REPORT #120776 / CLEAN UP CREW ENROUTE TO SCENE"

All Materials:

Site ID: 325044

Operable Unit ID: 1070377

Operable Unit: 01

Material ID: 316716

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 2.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S105055781 **DIST/DIR:** 0.030 WNW **ELEVATION:** 19 **MAP ID:** B23

NAME: FMR. GASSMAN FUEL CO.

Rev: 08/09/2021

ADDRESS: 511 E 132ND ST
BRONX, NY
BRONX

ID/Status: 0101831 / 2015-10-07
ID/Status: 231212
ID/Status: 2001-05-17

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: FMR. GASSMAN FUEL CO.

Address: 511 E 132ND ST

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0101831 / 2015-10-07

Facility ID: 0101831

Facility Type: ER

DER Facility ID: 190541

Site ID: 231212

DEC Region: 2

Spill Cause: Unknown

Spill Class: B3

SWIS: 0301

Spill Date: 2001-05-17

Investigator: RVKETANI

Referred To: EXCAVATION/ORC PLANNED

Reported to Dept: 2001-05-17

CID: 257

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2001-05-17

Spill Record Last Update: 2015-10-07

Spiller Name: Not reported

Spiller Company: Not reported

Spiller Address: 511 E 132ND ST

Spiller Company: 001

Contact Name: NORMAN PONDER

DEC Memo: "5/17/2001 - Sangesland was on site to watch the tank pull. The original tank was much larger than expected and extended under the building. This tank was opened, cleaned and abandoned in place. A second smaller tank was found in the rear next to the now abandoned tank. Contamination was found in the area of these 2 tanks. A third tank was found in the front corner of the building and was removed. 6/8/2001 - Sangesland sent a letter to the environmental contractor: Mr Jim Selano, WRT Corporation (phone 718-292-1920) DEC has directed Mr. Selano to install 2 wells in the area of the abandoned tank and back near the adjacent property line with Hess Gas Station. Water

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S105055781	DIST/DIR: 0.030 WNW	ELEVATION: 19	MAP ID: B23

NAME: FMR. GASSMAN FUEL CO.

Rev: 08/09/2021

ADDRESS: 511 E 132ND ST
BRONX, NY
BRONX

ID/Status: 0101831 / 2015-10-07

ID/Status: 231212

ID/Status: 2001-05-17

SOURCE: NY Department of Environmental Conservation

samples are to be tested to 8270 & 8021. He will submit a single report including results of the endpoint soil samples from the tank pull, results of the water tests, a narrative of the work done, a site plan of the area and a proposal for any additional work he feels may be necessary. 3/27/2002 Sangesland called Mr. Selano looking for the report discussed above. He said he is no longer working on the site and all contact should be with Mr. Holland. Called Mr. Holland at Bridge Lumber - 2447 3rd Ave, Bronx 10451 Tel # 718-585-3242) Sangesland spoke with Mr. Holland's son - Moishe. He said the wells were installed and the samples were taken. He would look into it and forward a copy of the test results to the DEC. 4/12/2002 - Nothing has been submitted to the DEC on this site. 6/18/2002 - Sangesland has made MANY calls to Mr. Dave Holland at 718-585-3242. None of these messages have been responded to. 6/24/2002 - Sangesland called Bridge Lumber again at 718-585-3242 . Still there is no response. 7/1/2002- Another call to Bridge Lumber number. Person who answered suggested another telephone number: 718-585-8787 ask for Paul. 8/5/2002 - Another call to Bridge Lumber. Left another message for Paul who is apparently the son of Dave Holland. 8/5/2002 - Sangesland wrote a Do Work letter to Mr. David Holland & Mr. Paul Holland. This letter will be hand delivered by an ECO. 9/4/2002 - Sangesland spoke with Paul Holland 718-585-3242 he said to call Moishe Altmark (a business partner) at 917-807-4738. Mr. Altmark stated that their consultant Mr. Jim Selano would manage the project (718-292-1920). A message was left on Mr. Selano's voice mail requesting a response. 10/2/2002 - Jim Selano said water samples were taken and results were faxed to the DEC office. (He will resubmit today). GeoProbe work will be done on the site later this week (10/4 ?) Jim would like to Geoprobe on the Hess side of the property. No word back yet from Hess. ****DO NOT CLOSE THIS SPILL UNTIL THE PROBLEM ON HESS SITE (BRUCKNER BLVD) IS SOLVED**** 11/22/2005: Project reassigned to Andersen. Review of file indicates that abovementioned fax in note dated 10/2/2002 of water sample results was received on that date. However, no map was provided indicating the location of the samples. The results of the geoprobe work was never received. The groundwater samples are clean. Called Jim Selano about missing information and he was not in the office. 11/28/05: Spoke with Jim Selano, he said that he would look for files and sent them later this week. 1/18/06: Have not received any information from Jim Selano. Called Jim Selano and spoke with someone else at the office. They said that they don't have any information and recommended I call David Holland (516-382-3559). Called David Holland and he was driving, he said to call Jack Gingold at 718-585-3242. Spoke with Jack Gingold, he said he would fax me a tank closure report. Received a fax with proof of the tank pull. 1/19/06: Received a second fax with the results of a tank tightness

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S105055781	DIST/DIR: 0.030 WNW	ELEVATION: 19	MAP ID: B23

NAME: FMR. GASSMAN FUEL CO.

Rev: 08/09/2021

ADDRESS: 511 E 132ND ST
BRONX, NY
BRONX

ID/Status: 0101831 / 2015-10-07

ID/Status: 231212

ID/Status: 2001-05-17

SOURCE: NY Department of Environmental Conservation

test. Spoke with Jack Gingold and said that soil samples and a site plan are required. He said he would speak with Jim Solano and get back to me in 10 days. Received another fax with lab testing data. 1/26/06: Spoke with Kathy Mucerino of Soil Mechanics. She said she will send me any information she has regarding the site. 4/17/06: Spoke with Kathy Mucerino. She will send copies of testing results. 6/21/06: Sent Kathy Mucerino an email requesting documentation on testing results. 6/29/06: Summary of information from 1/19/2006 fax: - H2M Labs - One endpoint soil sample collected from tank pull on 5/27/2001. Benzene exceedance of 120ppb (RSCO 60ppb). It is unclear if this is a grab or composite sample. - Environmental Testing Laboratories - Two groundwater samples collected on 9/16/2002. Benzene 11.8 ppb and MTBE 26.8ppb. - Long Island Laboratories - Four soil samples and two groundwater samples received by lab on 10/29/02 (probably collected during PID sampling on 10/28/02). Total VOC exceedances in soil borings GP-1 and GP-2. Isopropylbenzene and n-Propylbenzene exceedances in GP-2. Max MTBE 290ppb and benzene 10ppb in gw sample AQ#2. - Soil Mechanics - Soil sample PIDs from GP-1 - GP-4 on 10/28/02. PID as high as 737ppm in GP-1. - Site plan for the adjacent Hess property. Sampling indicates that soil and gw is contaminated but it is not clear the size and location of the plume due to a lack of site plan. Called Jack Gingold and requested that he contact Soil Mechanics and request a site plan. He said he will contact Soil Mechanics but will probably not be able to reach anyone until late next week on account of the July 4th holiday. 7/6/06: Spoke with Jack Gingold (914-714-9071). He contacted Soil Mechanics and they don't have a site plan. He is now contacting James Solano (800 507 1920) at Alliance Clouse Engineering (formerly WRP) to get a site plan. 8/11/06: Spoke with Jack Gingold. He spoke to James Solano regarding a site plan and he was on vacation. He will try to contact James Solano again. 8/24/06: Site visit scheduled for 8/29/06 at 1pm. 8/29/06: Site visit with Jeff Holland, Jack Gingold, and Jim Solano. Jim Solano states that three wells are currently present at the site. The area was not accessible for inspection. The original report produced after well installation was lost. The wells will be gauged and sampled, and a new report prepared and submitted to the Department. 9/13/06: Spoke with Jack Gingold. Jim Solano (800-507-1920) will survey the existing wells on Wednesday September 20, 2006. Wells will be gauged in the morning. (Andersen) 9/21/06: Received phone call from Jack Gingold. Monitoring wells could not be located. New wells will be installed. A mobilization date has not been scheduled. (Andersen) 9/29/06: Spoke with Jim Solano's secretary, a drilling date has not been scheduled yet. They are waiting to get a time from the drilling company. (Andersen) 10/6/06: Called Jim Solano to followup on well installation date. Well

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S105055781	DIST/DIR: 0.030 WNW	ELEVATION: 19	MAP ID: B23

NAME: FMR. GASSMAN FUEL CO.

Rev: 08/09/2021

ADDRESS: 511 E 132ND ST
BRONX, NY
BRONX

ID/Status: 0101831 / 2015-10-07

ID/Status: 231212

ID/Status: 2001-05-17

SOURCE: NY Department of Environmental Conservation

installation has not been scheduled yet.(Andersen) 10/13/06: Spoke with Jim Solano. Drilling has been tentatively scheduled for October 24th or 25th. He will call me next week to confirm. (Andersen) 10/20/06: Left message with secretary for Jim Solano to confirm delineation next week. (Andersen) 10/23/06: Left message with Jim Solano's secretary to confirm delineation date (Andersen). 10/24/06: Called Jim Solano and he was out of the office (Andersen). 10/25/06: Spoke with Jim Solano. He is still coordinating a mobilization date with the driller. (Andersen) 11/9/06: Left phone message with Jim Solano's secretary to followup on the status of delineation. (Andersen) 11/17/06: Spoke to Jim Solano. Drilling scheduled for 11/22/06. Call next week to confirm. 11/21/06: Called Jim Solano to confirm drilling date of tomorrow. He was not available, I left a voice message. 11/22/06: Called Jim Solano and he was out of the office. 11/29/06: Called Jim Solano and spoke to someone at the office, he is out of the office for the day. 12/11/06: Left a message for Jim Solano. 12/18/06: Left message for Jim Solano. 1/4/07: Left voice message for Jim Solano. 2/15/07: Left message for Jim Solano. 3/27/07: Spoke to Jack Gingold. He will talk to the engineer and return call. 6/4/07: Sent delineation required letter. Due 7/16/07. 6/19/07: Spoke to Jack Gingold. Jim Solano will install borings/wells. Jim Solano will send a workplan with proposed well locations. Jim Solano (cell) : 203-868-6383. 6/26/07: Letter to Jim Solano returned to sender. 6/27/07: Received phone message from Michelle Snider. 6/29/07: Spoke to Michelle Snider (631-589-6353). She will perform site visit and call back to discuss workplan next week. 7/6/07: Received FOIL request from Michelle Snider (cell: 516-315-6029). 7/24/07: Spoke to Michele Snider. She will submit a workplan involving a geophysical survey and installation of three wells. 8/2/07: Received a letter from Michelle Snider indicating a land survey and geophysical survey will be provided prior to submission of a workplan. 9/12/07: Left phone message for Michelle Snider to followup on workplan submittal. 9/18/07: Spoke to Michelle Snider. Workplan in progress. A geophysical survey was completed. 10/15/07: consultants contact info: Michelle E. Snider Sr. Project Manager P.W. Grosser Consulting 630 Johnson Avenue, Suite 7 Bohemia, NY 11716 631.589.6353 631.589.8705 michelles@pwgrosser.com 10/16/07: Approved workplan for installation of four soil borings and three wells at locations with highest soil impact. Investigation summary report due 1/16/07. 2/12/08: Received Soil and Groundwater Delineation Report. Four wells installed. Groundwater flow is northeast. Volatile organic compounds and semi volatile organic compounds are present in soil above soil standards. Low level VOCs and sVOCs present in groundwater. MTBE present at 100 ppb in MW1 although there is no record of a gasoline tank on site. 4/3/08 -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S105055781	DIST/DIR: 0.030 WNW	ELEVATION: 19	MAP ID: B23

NAME: FMR. GASSMAN FUEL CO.

Rev: 08/09/2021

ADDRESS: 511 E 132ND ST
BRONX, NY
BRONX

ID/Status: 0101831 / 2015-10-07
ID/Status: 231212
ID/Status: 2001-05-17

SOURCE: NY Department of Environmental Conservation

Carlson: Issued letter requiring quarterly sampling and reporting.
9/4/08 - Carlson: Reviewed update report dated August 27th, 2008. Low level VOCs present. Napthalene present, no other SVOCs. MTBE present although there was never a gasoline tank present. GW flow is NE towards the adjacent Hess station. 4/10/09 - Carlson: Spoke to John Eichler. A report was sent in November. He will resend it. 6/12/09 - Carlson: Received letter from John Eichler at P.W.Grosser. 10/8/09 - Carlson: Issued letter requiring an additional groundwater monitoring event. 2/3/2010 - Carlson: Issued letter requiring RAP to address remaining soil and groundwater impact. Due in 30 days. 5/25/2010 - Carlson: Reviewed RAP for excavation and ORC application to the excavation. Issued letter - addendum required by 6/25/2010 with ORC concentration and amount, and DO monitoring. 6/29/2010 - Carlson: Received email from John Eichler - Addendum to be submitted. 7/22/2010 - Carlson: Sent email - when will addendum be submitted? - it is overdue. 8/26/2010 - Carlson: Issued approval letter for RAWP and addendum - excavation will be completed, ORC to be left in excavation. Post-excavation quarterly groundwater monitoring and sampling planned. 'Jack Gingold' (jackgingold@msn.com) 4/18/11 - Obligado - This spill is transferred to Obligado from Brevdo. 12/9/11 - Carlson: Called John Eichler at PW Grosser, they are no longer working on the case. They did not implement the approved RAWP. Called Jack Gingold at 718-585-3242 and left message with his secretary. 10/6/15 - Raphael Ketani. I restarted the spill case. According to Google Earth, the site is presently a truck and construction equipment storage yard. However, a 1996 air photo from the NYCityMap database shows a very long red brick building situated north to south. There is a very thin vacant lot on the west side of the building bordering Brook Avenue. The east side of the building is bordered by a 1 story commercial building at 517 East 132nd Street. I checked the Property Shark database and a picture for 511 East 132nd Street shows the same red brick building with the sign Gassman Fuel Company. So this is the correct site. The Property Shark database also lists alternative addresses as 513 and 515 East 132nd Street. The block and lot for 511 doesn't exist in ACRIS, but they do exist for the 513 and 515 addresses. These properties are listed as block 2260 and lot 1. ACRIS had the latest deed as dated 12/10/12. The owners are 122 Bruckner Partners, LLC and 122 Bruckner Development, LLC, both at 2447 3rd Avenue, Bronx, 10451. These parties also own 517 East 132nd Street at block and lot 2260 and 38. The latest deed is also dated 12/10/12. According to the reports in the database, though the site address is 511 East 132nd Street, the actual investigative work took place in the northern half of the open paved area next to the building marked as 517 East 132nd Street. This is evident from the maps in the PW Grosser December 2007 Soil and

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S105055781	DIST/DIR: 0.030 WNW	ELEVATION: 19	MAP ID: B23

NAME: FMR. GASSMAN FUEL CO.

Rev: 08/09/2021

ADDRESS: 511 E 132ND ST
BRONX, NY
BRONX

ID/Status: 0101831 / 2015-10-07
ID/Status: 231212
ID/Status: 2001-05-17

SOURCE: NY Department of Environmental Conservation

Groundwater Delineation Report as the affected area is adjacent to the south of the HESS gas station. (According to reports in the database, the station had a 750 gallon gasoline spill on 1/22/87 - spill #8606553. A leaking #2 oil UST was removed during July 1992.) The sites' onsite USTs are also depicted as being under the northern half of this paved area. Spill #0101831 was called in when oil contaminated soil was discovered during the removal of one UST. There is a PBS case #2-309036 associated with this site. The owner is listed as 220 East Realty Inc., 511-517 East 132nd Street, Bronx, 10454. The site address is 511-517 East 132nd Street, Bronx. Mail would go to 220 East Realty Inc., 2447 Third Avenue, Bronx, 10454, attn. Dave Holland (718) 585-3242. The operator was Moshe Altmark, (718) 401-1511. Two 3000 gallon #2 oil USTs were removed. One 3000 gallon diesel UST was closed in place. Two 550 gallon #2 oil USTs were also closed in place (7/1/94). According to the PW Grosser December 2007 Soil and Groundwater Delineation Report dated 1/9/08, 4 soil borings were installed in the northern half of the asphalt paved area. These were locations MW-1 to MW-3 and MW-3A. They were conducted on 11/2/07. MW-1 was set right at the property line with the HESS station. MW-2 was further south, but near the property line. MW-3 and MW-3A were situated even further south. The soil samples from the 5 to 7.5 foot interval had hits. MW-1 had 3 VOCs with slight exceedences of the CP-51 unrestricted residential soil standards. MW-2 had 1 slight VOC exceedence. MW-3 had 1 slight VOC exceedence. None of the soil samples had benzene or naphthalene hits. The SVOC results were dominated by the benzo series of analytes, suggesting the presence of historical fill. There was an 1800 ppb naphthalene exceedence in the sample from MW-2. Low naphthalene hits were present in the other 3 samples. Groundwater elevation was determined to be from 10.51 feet to 7.12 feet with flow to the north towards the HESS station. The groundwater sample from MW-1 had 18 ppb benzene, 100 ppb MTBE and other very low to low VOCs. MW-2 and MW-3 had many non-detects and low VOC hits. SVOC results for all of the samples were mostly non-detect. According to the PW Grosser October 2009 Groundwater Sampling Event Report dated 11/2/09, groundwater samples were taken on 10/20/09. The sample from MW-1 had 17 ppb of benzene and 29 ppb of MTBE. MW-2 had 16 ppb of MTBE. There were no noteworthy VOC hits in the other two samples. The SVOC results were either entirely non-detect or mostly non-detect for all of the samples. There is a work plan in the case record from PW Grosser dated 3/12/10 and titled March 2010 RAP. The plan was to excavate in the vicinity of MW-2 possibly down to the water table at 7 feet. Then ORC Advanced would be used to treat the soil. This plan was never carried, according to the former DEC case manager Sarah Carlson. 10/7/15 - Raphael Ketani. Having reviewed the information in the case file, I

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S105055781 **DIST/DIR:** 0.030 WNW **ELEVATION:** 19 **MAP ID:** B23

NAME: FMR. GASSMAN FUEL CO.

Rev: 08/09/2021

ADDRESS: 511 E 132ND ST
BRONX, NY
BRONX

ID/Status: 0101831 / 2015-10-07

ID/Status: 231212

ID/Status: 2001-05-17

SOURCE: NY Department of Environmental Conservation

determined that the soil and groundwater contamination was minimal and not a threat to the public or the environment. I also determined that the spill at the HESS station was not significantly affecting conditions under the site. Therefore, I closed the spill case effective today. "

Remarks: "during a tank removal caller found contaminated soil around tank"

All Materials:

Site ID: 231212

Operable Unit ID: 840660

Operable Unit: 01

Material ID: 537532

Material Code: 0001A

Material Name: #2 fuel oil

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S109060082 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D24

NAME: BRUCKNER BD/BROOK AVE

Rev: 08/09/2021

ADDRESS: BRUCKNER BD/BROOK AVE
BRONX, NY
BRONX

ID/Status: 0712601 / 2008-03-03

ID/Status: 394241

ID/Status: 2008-03-01

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: BRUCKNER BD/BROOK AVE

Address: BRUCKNER BD/BROOK AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0712601 / 2008-03-03

Facility ID: 0712601

Facility Type: ER

DER Facility ID: 343809

Site ID: 394241

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: Not reported

SWIS: 0301

Spill Date: 2008-03-01

Investigator: vszhune

Referred To: Not reported

Reported to Dept: 2008-03-01

CID: 74

Water Affected: Not reported

Spill Source: Commercial Vehicle

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: Not reported

Remediation Phase: 0

Date Entered In Computer: 2008-03-01

Spill Record Last Update: 2008-03-03

Spiller Name: JOE REDDINGTON

Spiller Company: DEP

Spiller Address: BRUCKNER BD/BROOK AVE

Spiller Company: 001

Contact Name: JOE REDDINGTON

DEC Memo: "03/01/08- Zhune apoke to Joe Redington from DEP ph:(212)860-9315. He said the fuel line from the DEP Truck broke and spill approximetly 15 gallons of oil. Plate # of the truck M32599. DEP cleaned it up. No sewer, no groundwater affected. Spill Closed "

Remarks: "in process of cleaning Fuel line broke on the truck "

All Materials:

Site ID: 394241

Operable Unit ID: 1151186

Operable Unit: 01

Material ID: 2141892

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S109060082 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D24

NAME: BRUCKNER BD/BROOK AVE

Rev: 08/09/2021

ADDRESS: BRUCKNER BD/BROOK AVE
BRONX, NY
BRONX

ID/Status: 0712601 / 2008-03-03
ID/Status: 394241
ID/Status: 2008-03-01

SOURCE: NY Department of Environmental Conservation

Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 15.00
Units: G
Recovered: Not reported
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103936031	DIST/DIR: 0.035 North	ELEVATION: 18	MAP ID: D25

NAME: MANHOLE 21958

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/BROOK AVE
BRONX, NY
BRONX

ID/Status: 0401956 / 2004-09-09

ID/Status: 9900323 / 1999-04-20

ID/Status: 127047

ID/Status: 127048

ID/Status: 2004-05-21

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 21947

Address: BRUCKNER BLVD/BROOK AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0401956 / 2004-09-09

Facility ID: 0401956

Facility Type: ER

DER Facility ID: 109758

Site ID: 127047

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2004-05-21

Investigator: SKARAKHA

Referred To: Not reported

Reported to Dept: 2004-05-21

CID: 64

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2004-05-21

Spill Record Last Update: 2004-09-09

Spiller Name: ERT DESK

Spiller Company: SPEEDY LUBE / CAR WASH

Spiller Address: BROWN/BRUCKNER AV

Spiller Company: 001

Contact Name: ERT DESK

DEC Memo: "e2mis # 153514 Snr Field Oper I. Greene discovered 1 gal of unknown oil on 3 gallons of water. No smoke or fire is/was involved. No sewers, waterways, or private property affected. Env tag 23920 was placed and a pcb sample was taken on DD18617. At 18:30 Hrs. Flush Mechanic Tom Murphy reports finding source of oil is an active 3rd part source so spill is no longer eligible to be classified as a 24 hr underground deminimis spill. Source of the oil is a very heavy sheen coming from Speedy Lube and Car Wash , a 24 hour car wash and maintenance facility at the north east corner of Brown and Bruckner Avenues in the Bronx. Mr. Murphy will be taking a sample for Oil ID.

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103936031 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D25

NAME: MANHOLE 21958

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/BROOK AVE
BRONX, NY
BRONX

ID/Status: 0401956 / 2004-09-09

ID/Status: 9900323 / 1999-04-20

ID/Status: 127047

ID/Status: 127048

SOURCE: NY Department of Environmental Conservation

ID/Status: 2004-05-21

Mr. Murphy reports the source facility is active and upgradient from the manhole being cleaned. Wash water containing a heavy sheen is leaving the facility and running down the curb line into the structure where it is being accumulated. FOD on location confirm source. Photographer being dispatched to the location. Lab Sequence Number: 04-03964-001: PCBs < 1 ppm 21-May-20 22:20 Hrs Flush Mechanic Tom Murphy, 21162, reports cleanup complete. Crews double washed and rinsed structure. A dust collar has been cemented into place to reduce amount/eliminate amount of oily water entering structure from the street. Sump still makes water, but with no sign of sheen or oil." Not reported

Remarks: "Caller states that there is a sheen coming from a 24 hr car wash at the intersection of Brown and Bruckner Blvd's. (Speedy Lube and Car wash)"

All Materials:

Site ID: 127047

Operable Unit ID: 885835

Operable Unit: 01

Material ID: 493141

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Name: MANHOLE 21958

Address: BRUCKNER BLVD/BROOK AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9900323 / 1999-04-20

Facility ID: 9900323

Facility Type: ER

DER Facility ID: 109758

Site ID: 127048

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 1999-04-08

Investigator: JHOCONNE

Referred To: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103936031 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D25

NAME: MANHOLE 21958

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/BROOK AVE
BRONX, NY
BRONX

ID/Status: 0401956 / 2004-09-09

ID/Status: 9900323 / 1999-04-20

ID/Status: 127047

ID/Status: 127048

ID/Status: 2004-05-21

SOURCE: NY Department of Environmental Conservation

Reported to Dept: 1999-04-08

CID: 371

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1999-04-08

Spill Record Last Update: 2000-06-15

Spiller Name: ABOVE

Spiller Company: CON EDISON

Spiller Address: 4 IRVING PLACE

Spiller Company: 001

Contact Name: Not reported

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL Con ed e2mis notes: Approx 1 pt of fluid leaking from a FDR

in mh. Oil is a heavy sludge in corner of hole. Pads and absorb was

placed in hole to soak up fluid. Plates indicate there is a sewer

connection in hole. With the amount of spill and action taken by crew

on location, we can assume oil is contained at this time. Sample

type: oil AROCLOR 1254 2392 ppm An additional sample has been

requested...according to supv G. Meirs sample was taken directly from

joint in mh that was leaking. Joint in question is classified as a

Type II D fault. Given this, the feeder (3M50) must be de-energized

before further access to the manhole can be made. At this time, 3M46

is out of service (open auto). 3M50 will be de-energized once 3M46 is

returned to service. Note that the leak has been contained with

absorbent pads and absorbent pads have been placed on the impacted

area below the joint. Additional information indicates that the

feeder in question is a retired Railroad feeder and not 3M50. Efforts

will be made to identify the feeder so that the structure can be

accessed. ERT Dave Perez was called to see what's the ruling is about

moving a 5 gal plastic drum containing saran gloves and plastic bag

over 500 ppm to eastview. He said it was ok, Schlembach. Cleanup

complete at 16:00 and a chemist took wipe samples pending the

results. Sample Type: Wipe 1254 <1.00 ug/100 cme2 Tag was removed for

mh, S.Dixon a "

Remarks: "1 qt leaked from a failed seeder joint - sample taken - clean up
pending test results -- con ed 124118."

All Materials:

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103936031 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D25

NAME: MANHOLE 21958

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/BROOK AVE
BRONX, NY
BRONX

ID/Status: 0401956 / 2004-09-09

ID/Status: 9900323 / 1999-04-20

ID/Status: 127047

ID/Status: 127048

SOURCE: NY Department of Environmental Conservation

ID/Status: 2004-05-21

Site ID: 127048
Operable Unit ID: 1075114
Operable Unit: 01
Material ID: 307462
Material Code: 0541A
Material Name: dielectric fluid
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106867216 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D26

NAME: MANHOLE#21948(FRONT OF)

Rev: 08/09/2021

ADDRESS: BRUCKNER/BROOK AVE
BRONX, NY
BRONX

ID/Status: 0413046 / 2005-12-28
ID/Status: 338685
ID/Status: 2005-03-15

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE#21948(FRONT OF)

Address: BRUCKNER/BROOK AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0413046 / 2005-12-28

Facility ID: 0413046

Facility Type: ER

DER Facility ID: 274030

Site ID: 338685

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2005-03-15

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 2005-03-15

CID: 444

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2005-03-15

Spill Record Last Update: 2005-12-28

Spiller Name: ERT DESK

Spiller Company: MANHOLE#21948(FRONT OF)

Spiller Address: BRUCKNER/BROOK AVE

Spiller Company: 001

Contact Name: ERT DESK

DEC Memo: "e2mis no. 157615: 15-Mar-2005 11:39 hrs FOD Sr. Field Oper. William

Campbell 18857 reported he pumped 10 gals of water when 1 pint of unk granular oily substance was pumped to street in mixture, he then saw

10 gals of the same unknown granular oily liquid on cables in

MH-21948 on 100 gals of water while pumping to mark up dead feeder

cables. Env yellow tag 25799 placed in MH. Sample for oil ID and PCB

taken on coc DD08945. Lab Sequence Number: 05-02306-001 Date

Approved: 3/15/2005 TOTAL PCB <1.00 ppm Lab Sequence Number:

05-02307-001 Date Approved: 3/15/2005 analysis indicates the presence

of asphalt. 16-Mar-2005 00:20 hrs Through discussion with EH&S Spec.

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106867216 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D26

NAME: MANHOLE#21948(FRONT OF)

Rev: 08/09/2021

ADDRESS: BRUCKNER/BROOK AVE
BRONX, NY
BRONX

ID/Status: 0413046 / 2005-12-28

ID/Status: 338685

ID/Status: 2005-03-15

SOURCE: NY Department of Environmental Conservation

R. Benkwitt it is reported that FOD Sr. Field Oper. William Campbell 18857 completed cleanup of product to street, asphalt, at 11:30hrs on 15-Mar-2005.(reference E2MIS report 157617). Street was cleaned utilizing speedy dry and bagged (large bag). Waste was temporarily held pending analysis of samples. Samples came back 0 PPM and ID'd as asphalt. Waste now handled as non-haz and disposed of in Van Nest Service center as oily debris waste. Spill to street being closed out in this report as per discussions with ERT D. Pontecorvo (approx. 22:00hrs 3/15/05) and spill in MH 21948 (E2MIS 157617) of same substance (asphalt) will be addressed by 2300hr crews and a CFS under 50 tanker. ERT D. Pontecorvo will contact NYC DEP to inform them of progress of cleanup in MH and completion of cleanup to street. 12-Sep-2005 08:42 As per e2mis 157615-Env. Flush Mech. E. Henn 14210 reports cleanup complete (02:58hrs). CFS tanker took on 750 gallons of liquid for transport and disposal at Astoria WWTF. Env. flush vactor took on 700lbs. of flush debris for transport and disposal at the Hellgate TSF. Structure was double washed and rinsed utilizing bio-ge 760 soap. Source of oil was asphalt in structure from past road work on street. Structure reported as making water slowly through ducts. Env. tag 25799 pulled from structure."

Remarks: "1 pint of oil: they were pumping out the manhole and 10 gallons of water and oil , and inthe manhole there is still 10 gallons of unknown on 100 gallons of water: no to 5 questions: coned # 157615"

All Materials:

Site ID: 338685

Operable Unit ID: 1100617

Operable Unit: 01

Material ID: 580913

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103937509 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D27

NAME: MH 21948

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/BROOK AVE
BRONX, NY
BRONX

ID/Status: 9901997 / 1999-07-20

ID/Status: 127049

ID/Status: 1999-05-21

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MH 21948

Address: BRUCKNER BLVD/BROOK AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9901997 / 1999-07-20

Facility ID: 9901997

Facility Type: ER

DER Facility ID: 109758

Site ID: 127049

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 1999-05-21

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 1999-05-21

CID: 270

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1999-05-21

Spill Record Last Update: 2000-06-13

Spiller Name: UNK

Spiller Company: UNKNOWN

Spiller Address: UNK

Spiller Company: 001

Contact Name: CALLER

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL Con ed e2mis notes: Mh, approx 1 pint oil in approx 1000

gal water. Cleanup complete. oil and grease: 1pt pcb 0ppm AROCLOR

1242: 1PPM AROCLOR 1254: 1PPM AROCLOR 1260: 1PPM "

Remarks: "1 PT ON 1000 GAL WATER SAMPLES TAKEN CLEAN UP PENDING 125017"

All Materials:

Site ID: 127049

Operable Unit ID: 1076761

Operable Unit: 01

Material ID: 305520

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103937509 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D27

NAME: MH 21948

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/BROOK AVE
BRONX, NY
BRONX

ID/Status: 9901997 / 1999-07-20
ID/Status: 127049
ID/Status: 1999-05-21

SOURCE: NY Department of Environmental Conservation

Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103938312 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D28

NAME: MANHOLE 1636

Rev: 08/09/2021

ADDRESS: BROOK AVE/BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9902874 / 2002-04-15

ID/Status: 259597

ID/Status: 1999-06-12

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 1636

Address: BROOK AVE/BRUCKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9902874 / 2002-04-15

Facility ID: 9902874

Facility Type: ER

DER Facility ID: 212311

Site ID: 259597

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 1999-06-12

Investigator: CAENGELH

Referred To: Not reported

Reported to Dept: 1999-06-12

CID: 199

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1999-06-12

Spill Record Last Update: 2002-04-15

Spiller Name: Not reported

Spiller Company: Not reported

Spiller Address: Not reported

Spiller Company: 001

Contact Name: Not reported

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
ENGELHARDT e2mis no. 125-529: 1406/12/99 1025 HRS. C BROWN (RW) FOUND
UNKNOWN OIL IN MH 1636 APPX 1 QT OIL & 1 GAL .WATER. CONDUIT PLATE #
4C3 SHOWS A SEWER CONNECTION ASSUMED NO WATER LEFT SUMP SEWER
CONNECTION IS CLOG OR SEAL. OIL & WATER IS CONTAINED IN MH. PLACED
TAG # 24288 & TOOK SAMPLE. UPDATE: Saturday, 12 June 1999 4:45pm ET
Lab Sequence Number: 99-06099 PCBs 3415 PPM JUNE 14, 1999 SUPERVISOR
FISCHER REPORTS THAT CLEAN UP HAS BEEN COMPLETED. MANHOLE WAS FLUSHED
AND SODA BLASTED. CHEMIST TOOK SAMPLES. JUNE 21, 1999 REPORT FROM
SUPERVISOR FISCHER LAB SEQUENCE # 99-06162 RESULTS SHOW 6/21 WIPE

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103938312 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D28

NAME: MANHOLE 1636

Rev: 08/09/2021

ADDRESS: BROOK AVE/BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9902874 / 2002-04-15

ID/Status: 259597

ID/Status: 1999-06-12

SOURCE: NY Department of Environmental Conservation

SAMPLES PASSED. STRUCTURE HAS TO BE RECLEANED. 5-17-00 12:18

L.Fischer reports mh inspected on 5-16-00, 2-sets of 3M joints and 16' of asbestos to be removed. L.Fischer made 2- C faults and gave them to Feeder Control. Job cannot be scheduled due to the two feeders in manhole with 3m joints...feeders must be removed from service to clean structure. August 4, 2000 Report from Supervisor C. D'Alisera, tanker removed approximately 750 gallons of liquid from manhole in order for Q & A to perform an inspection of manhole. There are 5 former railroad cables that are cut and capped and abandoned in place. There are six feeders in this manhole. Supervisor recommends that that the railroad cables be removed from the manhole prior to any additional work be performed. This type of cable that has been abandoned is known to contain high counts of PCB's. Removing them will remove the source of oil that caused this high count. Supervisor D'Alisera will schedule the removal of the 5 cables the week of August 21st, 2000. Sept 27, 2000 Job update (2) 3m snap joints on feeders 3m45 and 3m51 were repaired on OOE saturday 9/23. Next phase is for the 4 dead railroad cables be identified for removal before clean up can be performed. 10/12/00 2 railroad feeders were removed today and cleanup has been scheduled for 10/13. Oct 10, 2000 @ 1610 HRS Received report from Supervisor C.Dalisera, cable removed 2 sections of Railroad Feeders, cut 3 joints in manhole. Removed 1 joint...the remaining 2 joints and 2 sections of RR feeder cable will be removed on wednesday 10/11/00. Oct 11, 2000 @ 1500 Remaining 2 sections of RR cables have been removed. 10/16/2000 cleanup is completed. 150 gallons of water removed with no presents of oil by corporate tanker. Hole was double washed and also soda blasted. Wipe samples taken by chemist. Oct 27, 2000 Results of 8 wipe samples LSN 00-10198. 4 passed and 4 failed. Job to be rescheduled for cleaning 10/31/00. 11/01/00 12:13 hrs L. Fischer reports that 10 gallons of liquid was removed from the structure by >50 ppm corporate tanker. The manhole was recleaned and soda blasted by company forces. Wipe sample taken by Chem Lab, results are pending. 11/6/00 All samples came back OK. This job can be closed out. Final cleaning (Soda Blast) was successful."

Remarks: "1 qt of unk type oil found on 1 gal of water - sample taken and when results are known cleanup will begin - con ed spill 125529"

All Materials:

Site ID: 259597

Operable Unit ID: 1081787

Operable Unit: 01

Material ID: 553111

Material Code: 0066A

Material Name: unknown petroleum

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103938312 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D28

NAME: MANHOLE 1636

Rev: 08/09/2021

ADDRESS: BROOK AVE/BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9902874 / 2002-04-15
ID/Status: 259597
ID/Status: 1999-06-12

SOURCE: NY Department of Environmental Conservation

Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106867219 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D29

NAME: MAHNHOLE # 21948

Rev: 08/09/2021

ADDRESS: BRUCKNER/BROOK AVE
BRONX, NY
BRONX

ID/Status: 0413054 / 2005-03-16

ID/Status: 338695

ID/Status: 2005-03-15

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MAHNHOLE # 21948

Address: BRUCKNER/BROOK AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0413054 / 2005-03-16

Facility ID: 0413054

Facility Type: ER

DER Facility ID: 274030

Site ID: 338695

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2005-03-15

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 2005-03-15

CID: 444

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2005-03-15

Spill Record Last Update: 2005-03-16

Spiller Name: Not reported

Spiller Company: Not reported

Spiller Address: Not reported

Spiller Company: 001

Contact Name: ERT DESK

DEC Memo: "Close out - see spill # 0413046. (JHO) ~~~~~ E2MIS

NO. 157617: 15-MAR-2005 12:53 hrs. FOD Sr Field oper. Bill Campbell

18857 reported 10 gals of unk oil in MH-21948 on 100 gals of water

while dewatering for marking dead fdr cable. See e2MIS 157615 [DEC

spill # 0413046]. Cleanup street started at 11:16 hrs on e2MIS 157615

and completed at 11:30 hrs in street. Samples taken on 157615 for

this MH."

Remarks: "NO TO 5 QUESTIONS CONED # 157657: ON 100 GALLONS OF WATER:"

All Materials:

Site ID: 338695

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106867219 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D29

NAME: MAHNHOLE # 21948

Rev: 08/09/2021

ADDRESS: BRUCKNER/BROOK AVE
BRONX, NY
BRONX

ID/Status: 0413054 / 2005-03-16
ID/Status: 338695
ID/Status: 2005-03-15

SOURCE: NY Department of Environmental Conservation

Operable Unit ID: 1100625

Operable Unit: 01

Material ID: 580921

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 10.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103271796 **DIST/DIR:** 0.035 North **ELEVATION:** 18 **MAP ID:** D30

NAME: BROOK AVE/BRUCKNER BLVD

Rev: 08/09/2021

ADDRESS: BROOK AVE/BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9507731 / 1995-09-25

ID/Status: 259596

ID/Status: 1995-09-25

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: BROOK AVE/BRUCKNER BLVD

Address: BROOK AVE/BRUCKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9507731 / 1995-09-25

Facility ID: 9507731

Facility Type: ER

DER Facility ID: 212311

Site ID: 259596

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C6

SWIS: 0301

Spill Date: 1995-09-25

Investigator: SMMARTIN

Referred To: Not reported

Reported to Dept: 1995-09-25

CID: 311

Water Affected: Not reported

Spill Source: Tank Truck

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1995-09-25

Spill Record Last Update: 1999-10-04

Spiller Name: MATT MARKLEY

Spiller Company: ROBINSON OIL

Spiller Address: 500 EXECUTIVE BLVD

Spiller Company: 001

Contact Name: MATT MARKLEY

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

MARTINKAT CREW ENROUTE - F.D. ON SCENE (SPOKE TO MARKLEY)"

Remarks: "DRIVER WAS TURNING A CORNER AND HOSE POPPED OFF SIDE OF TRUCK

SPILLING PRODUCT ON ROADWAY."

All Materials:

Site ID: 259596

Operable Unit ID: 1018597

Operable Unit: 01

Material ID: 362166

Material Code: 0001A

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S103271796	DIST/DIR:	0.035 North	ELEVATION:	18	MAP ID:	D30

NAME: BROOK AVE/BRUCKNER BLVD

Rev: 08/09/2021

ADDRESS: BROOK AVE/BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9507731 / 1995-09-25

ID/Status: 259596

ID/Status: 1995-09-25

SOURCE: NY Department of Environmental Conservation

Material Name: #2 fuel oil

Case No.: Not reported

Material FA: Petroleum

Quantity: 10.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010326220 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D31

NAME: CON EDISON MANHOLE 1391

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004140059

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20060707

Handler Name: CON EDISON MANHOLE 1391

Handler Address: BRUCKNER BLVD & BROOK AVE

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004140059

Contact Name: MICHAEL DAUGHTREY

Contact Address: 4 IRVING PL, RM 828

Contact City,State,Zip: NEW YORK, NY 10003

Contact Telephone: 212-580-8383

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Not reported

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: 4 IRVING PL, RM 828

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010326220 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D31

NAME: CON EDISON MANHOLE 1391

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004140059

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20060705
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010326220 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D31

NAME: CON EDISON MANHOLE 1391

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004140059

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Not reported
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060706
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060707
Handler Name: CON EDISON MANHOLE 1391
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010326220 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D31

NAME: CON EDISON MANHOLE 1391

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004140059

SOURCE: US Environmental Protection Agency

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103273440 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D32

NAME: MANHOLE MH-21948

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY
BRONX

ID/Status: 9800381 / 1998-04-13

ID/Status: 199904

ID/Status: 1998-04-09

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE MH-21948

Address: BRUCKNER BLVD & BROOK AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9800381 / 1998-04-13

Facility ID: 9800381

Facility Type: ER

DER Facility ID: 166355

Site ID: 199904

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 1998-04-09

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 1998-04-09

CID: 366

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1998-04-09

Spill Record Last Update: 2003-03-06

Spiller Name: MIKE CESARE

Spiller Company: CON ED

Spiller Address: 4 IRVING PL

Spiller Company: 001

Contact Name: Not reported

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL 4/9/98, 1540 hrs: Dave Perez, Con Ed ERT - 5 gallons of oil/water mixture in manhole. Tagged and closed - went back to clean today. They accidentally pulled out drain plug. Drawing for manhole

shows direct sewer connection. Analysis - 5 ppm PCB. E2MIS 115556

MAR. 25, 1998 H. GRAHAM #25749 BX CABLE GANG FOUND OIL IN MH-21948

WHILE PULLING CABLE ON FDR 3M60. SAMPLE WAS TAKEN AND TAG #16713 WAS

PLACED IN HOLE. HOLE CONTAINED APPROX 5 GALLONS OF OIL IN APPROX 10

GALLONS OF WATER. OIL AND WATER ARE CONTAINED IN HOLE WITH NO RELEASE

09-APR-98, 1018 HRS AT 1015 HRS UG J.SCHMITT REPORTED THAT WHILE

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103273440 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D32

NAME: MANHOLE MH-21948

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY
BRONX

ID/Status: 9800381 / 1998-04-13

ID/Status: 199904

ID/Status: 1998-04-09

SOURCE: NY Department of Environmental Conservation

FLUSHING/CLEANING THE MANHOLE THE SEWER PLUG FELL OUT. APPROX TWO GALLONS OF OIL/WATER MIXTURE WENT DOWN THE SEWER DRAIN. THIS TOOK PLACE AT 1000 HRS. SCHMITT IS STANDING BY WITH THE TANKER TRUCK, WAITING FOR MATERIALS TO REPLUG THE DRAIN. O.S. J.BEEKMAN PAGED. 09-APR-98 CIG CESARE NOTIFIED 10:32 HOURS. 09-APR-98 1107 HRS INVESTIGATED M&S PLATE 4-C-3. PRINT SHOWS NO SEWER CONNECTION FOR MANHOLE 21948. O.S. J.BEEKMAN WILL INVESTIGATE AND CALL ME FROM THE LOCATION."

Remarks: "caller states while removing product, a problem with equipment caused product to leak into sewer."

All Materials:

Site ID: 199904

Operable Unit ID: 1057735

Operable Unit: 01

Material ID: 322354

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 2.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S108763873 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D33

NAME: ONE QT DIELECTRIC FLUID IN MH # 21953

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD & BROOK STREET
BRONX, NY
BRONX

ID/Status: 0705761 / 2007-11-08

ID/Status: 386130

ID/Status: 2007-08-20

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: ONE QT DIELECTRIC FLUID IN MH # 21953

Address: BRUCKNER BLVD & BROOK STREET

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0705761 / 2007-11-08

Facility ID: 0705761

Facility Type: ER

DER Facility ID: 335524

Site ID: 386130

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 2007-08-20

Investigator: gdbreen

Referred To: Not reported

Reported to Dept: 2007-08-20

CID: 410

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Local Agency

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2007-08-20

Spill Record Last Update: 2007-11-08

Spiller Name: ERTSDESK

Spiller Company: CON EDISON MH # 21953

Spiller Address: BRUCKNER BLVD / BROOK ST

Spiller Company: 999

Contact Name: ERTSDESK

DEC Memo: "11/08/07 - See eDocs for Con Ed report detailing cleanup and closure. 207652. see eDocs"

Remarks: "SPILL AMOUNT LESS THAN ONE QUART, MAY BE A TITLE HOLE, CONED # 207652"

All Materials:

Site ID: 386130

Operable Unit ID: 1143379

Operable Unit: 01

Material ID: 2133656

Material Code: 0541A

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S108763873	DIST/DIR:	0.036 NNW	ELEVATION:	18	MAP ID:	D33

NAME: ONE QT DIELECTRIC FLUID IN MH # 21953

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD & BROOK STREET
BRONX, NY
BRONX

ID/Status: 0705761 / 2007-11-08

ID/Status: 386130

ID/Status: 2007-08-20

SOURCE: NY Department of Environmental Conservation

Material Name: dielectric fluid

Case No.: Not reported

Material FA: Petroleum

Quantity: Not reported

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S108763886 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D34

NAME: ONE QT FROM OPEN CABLE ENDS IN

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD & BROOK AVENUE
BRONX, NY
BRONX

ID/Status: 0705779 / 2007-09-20

ID/Status: 386150

ID/Status: 2007-08-20

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: ONE QT FROM OPEN CABLE ENDS IN

Address: BRUCKNER BLVD & BROOK AVENUE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0705779 / 2007-09-20

Facility ID: 0705779

Facility Type: ER

DER Facility ID: 335539

Site ID: 386150

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2007-08-20

Investigator: gdbreen

Referred To: Not reported

Reported to Dept: 2007-08-20

CID: 408

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2007-08-20

Spill Record Last Update: 2007-09-20

Spiller Name: ERTSDESK

Spiller Company: CON EDISON MH #21948

Spiller Address: N BRUCKNER BLVD/

Spiller Company: 999

Contact Name: ERTSDESK

DEC Memo: "09/20/07 - See eDocs for Con Ed report detailing cleanup and closure. 207661. see eDocs"

Remarks: "1 QUART OF MATERIAL ON 50 GALLONS OF WATER; 68 FT WEST OF BROOK AVE.; NOT CONTAINED; REF #207661"

All Materials:

Site ID: 386150

Operable Unit ID: 1143399

Operable Unit: 01

Material ID: 2133676

Material Code: 0541A

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S108763886 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D34

NAME: ONE QT FROM OPEN CABLE ENDS IN

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD & BROOK AVENUE
BRONX, NY
BRONX

ID/Status: 0705779 / 2007-09-20

ID/Status: 386150

ID/Status: 2007-08-20

SOURCE: NY Department of Environmental Conservation

Material Name: dielectric fluid

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1014918462 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D35

NAME: CON EDISON MANHOLE 21987

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004220760

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20111228

Handler Name: CON EDISON MANHOLE 21987

Handler Address: BRUCKNER BLVD & BROOK AVE

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004220760

Contact Name: GINO FRABASILE

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 914-925-6219

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: SR SPECIALIST

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL RM 828

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1014918462	DIST/DIR: 0.036 NNW	ELEVATION: 18	MAP ID: D35

NAME: CON EDISON MANHOLE 21987

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004220760

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20110701
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20101128
Handler Name: CON EDISON MANHOLE 21987

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1014918462 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D35

NAME: CON EDISON MANHOLE 21987

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004220760

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

Receive Date: 20111228

Handler Name: CON EDISON MANHOLE 21987

Federal Waste Generator Description: Not a generator, verified

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: Yes

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S108763858 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D36

NAME: SIX GAL OIL IN MANHOLE 21950
ADDRESS: BRUCKNER BLVD AND BROOK AVENUE
BRONX, NY
BRONX
SOURCE: NY Department of Environmental Conservation

Rev: 08/09/2021
ID/Status: 0705744 / 2007-09-20
ID/Status: 386110
ID/Status: 2007-08-19

SPILLS:

Name: SIX GAL OIL IN MANHOLE 21950
Address: BRUCKNER BLVD AND BROOK AVENUE
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 0705744 / 2007-09-20
Facility ID: 0705744
Facility Type: ER
DER Facility ID: 335502
Site ID: 386110
DEC Region: 2
Spill Cause: Unknown
Spill Class: C4
SWIS: 0301
Spill Date: 2007-08-19
Investigator: gdbreen
Referred To: Not reported
Reported to Dept: 2007-08-19
CID: 75
Water Affected: NA.
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2007-08-19
Spill Record Last Update: 2007-09-20
Spiller Name: ERTSDESK
Spiller Company: CON EDISON MH 21950
Spiller Address: BRUCKNER BLVD.BROOK AVE
Spiller Company: 999
Contact Name: ERTSDESK
DEC Memo: "09/20/07 - See eDocs for Con Ed report detailing cleanup and closure. 207844. see eDocs"
Remarks: "unk source 6 gals onto 1000 gals water in this manhole-clean up enr CON ED 207644"

All Materials:
Site ID: 386110
Operable Unit ID: 1143359
Operable Unit: 01
Material ID: 2133636
Material Code: 0066A

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S108763858	DIST/DIR:	0.036 NNW	ELEVATION:	18	MAP ID:	D36

NAME: SIX GAL OIL IN MANHOLE 21950

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD AND BROOK AVENUE
BRONX, NY
BRONX

ID/Status: 0705744 / 2007-09-20
ID/Status: 386110
ID/Status: 2007-08-19

SOURCE: NY Department of Environmental Conservation

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 6.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1012185290 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D37

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10455
BRONX

ID/Status: NYP004160933

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20160601

Handler Name: CON EDISON

Handler Address: BRUCKNER BLVD & BROOK AVE

Handler City,State,Zip: BRONX, NY 10455

EPA ID: NYP004160933

Contact Name: HERMAN BAKER

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 718-267-3853

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: 4 IRVING PL, RM 828

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1012185290 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D37

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10455
BRONX

ID/Status: NYP004160933

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160606
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20080905
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1012185290 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D37

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10455
BRONX

ID/Status: NYP004160933

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator

State District Owner: Not reported

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

Receive Date: 20160601

Handler Name: CON EDISON

Federal Waste Generator Description: Not a generator, verified

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: Yes

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280300 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D38

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004751731

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150316

Handler Name: CON EDISON

Handler Address: BRUCKNER BLVD & BROOK AVE

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004751731

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL, 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280300 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D38

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004751731

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160502
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Biennial: List of Years
Year: 2015

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280300 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D38

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004751731

SOURCE: US Environmental Protection Agency

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code: D008

Waste Description: LEAD

Handler - Owner Operator:

Owner/Operator Indicator: Owner

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20150316

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20150316

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20160205

Handler Name: CON EDISON - MANHOLE 1391

Federal Waste Generator Description: Large Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280300 **DIST/DIR:** 0.036 NNW **ELEVATION:** 18 **MAP ID:** D38

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROOK AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004751731

SOURCE: US Environmental Protection Agency

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150316
Handler Name: CON EDISON
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150316
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 221122
NAICS Description: ELECTRIC POWER DISTRIBUTION

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1012184998 **DIST/DIR:** 0.037 NNE **ELEVATION:** 18 **MAP ID:** D39

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 125 BRUCKNER BLVD
BRONX, NY 10455
BRONX

ID/Status: NYP004157657

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20160601

Handler Name: CON EDISON

Handler Address: 125 BRUCKNER BLVD

Handler City,State,Zip: BRONX, NY 10455

EPA ID: NYP004157657

Contact Name: PATRICK HANLEY

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 718-204-4234

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: 4 IRVING PL, RM 828

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1012184998 **DIST/DIR:** 0.037 NNE **ELEVATION:** 18 **MAP ID:** D39

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 125 BRUCKNER BLVD
BRONX, NY 10455
BRONX

ID/Status: NYP004157657

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDs Where RCRA CA has Been Imposed Universe: No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSD Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160606
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20080331
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1012184998 **DIST/DIR:** 0.037 NNE **ELEVATION:** 18 **MAP ID:** D39

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 125 BRUCKNER BLVD
BRONX, NY 10455
BRONX

ID/Status: NYP004157657

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator

State District Owner: Not reported

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

Receive Date: 20160601

Handler Name: CON EDISON

Federal Waste Generator Description: Not a generator, verified

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: Yes

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S100145372 **DIST/DIR:** 0.037 ESE **ELEVATION:** 18 **MAP ID:** 40

NAME: CLOSED-LACKOF RECENT INFO

Rev: 08/09/2021

ADDRESS: (NO STREET INFO)

ID/Status: 8809318 / 2003-03-05

BRONX, NY

ID/Status: 109456

BRONX

ID/Status: 1989-03-02

SOURCE: NY Department of Environmental Conservation

LTANKS:

Name: CLOSED-LACKOF RECENT INFO

Address: (NO STREET INFO)

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 8809318 / 2003-03-05

Facility ID: 8809318

Site ID: 109456

Spill Date: 1989-03-02

Spill Cause: Tank Test Failure

Spill Source: Commercial/Industrial

Spill Class: C4

Cleanup Ceased: Not reported

SWIS: 0301

Investigator: ADMIN. CLOSED

Referred To: Not reported

Reported to Dept: 1989-03-02

CID: Not reported

Water Affected: Not reported

Spill Notifier: Tank Tester

Last Inspection: Not reported

Recommended Penalty: False

Meets Standard: False

UST Involvement: False

Remediation Phase: 0

Date Entered In Computer: 1989-03-03

Spill Record Last Update: 2003-03-14

Spiller Name: Not reported

Spiller Company: U S POSTAL AUTH

Spiller Address: Not reported

Spiller County: 001

Spiller Contact: Not reported

Spiller Phone: Not reported

Spiller Extention: Not reported

DEC Region: 2

DER Facility ID: 96085

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

ADMIN.CLOSED 03/05/2003- Closed Due To The Nature / Extent Of The

Spill Report"

Remarks: "TWO 10K TANKS MANIFOLDED TOGETHER. VISIBLE LEAK. NO MORE THAN 10 GAL
ON GROUND.CLOSED DUE TO LACK OF ANY RECENT INFO- DOES NOT MEET ANY
CLEAN UP REQUIREMENTS."

All TTF:

Facility ID: 8809318

Spill Number: 8809318

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S100145372 **DIST/DIR:** 0.037 ESE **ELEVATION:** 18 **MAP ID:** 40

NAME: CLOSED-LACKOF RECENT INFO

Rev: 08/09/2021

ADDRESS: (NO STREET INFO)
BRONX, NY
BRONX

ID/Status: 8809318 / 2003-03-05
ID/Status: 109456
ID/Status: 1989-03-02

SOURCE: NY Department of Environmental Conservation

Spill Tank Test: 1535217
Site ID: 109456
Tank Number: Not reported
Tank Size: 0
Material: 0001
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:
Site ID: 109456
Operable Unit ID: 925566
Operable Unit: 01
Material ID: 454070
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: L
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019903301 **DIST/DIR:** 0.040 NNE **ELEVATION:** 18 **MAP ID:** D41

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 121 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYP004783882

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150518

Handler Name: CON EDISON

Handler Address: 121 BRUCKNER BLVD

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004783882

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019903301 **DIST/DIR:** 0.040 NNE **ELEVATION:** 18 **MAP ID:** D41

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 121 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYP004783882

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150518
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019903301 **DIST/DIR:** 0.040 NNE **ELEVATION:** 18 **MAP ID:** D41

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 121 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYP004783882

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150518
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000446219	DIST/DIR: 0.040 NE	ELEVATION: 18	MAP ID: E42

NAME: AAMCO TRANSMISSIONS

Rev: 09/13/2021

ADDRESS: 131 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYD986905693

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20070101
 Handler Name: AAMCO TRANSMISSIONS
 Handler Address: 131 BRUCKNER BLVD
 Handler City,State,Zip: BRONX, NY 10454
 EPA ID: NYD986905693
 Contact Name: MIKE SOLLITTO
 Contact Address: BRUCKNER BLVD
 Contact City,State,Zip: BRONX, NY 10454
 Contact Telephone: 718-585-8435
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Not reported
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R2
 Mailing Address: BRUCKNER BLVD
 Mailing City,State,Zip: BRONX, NY 10454
 Owner Name: AAMCO TRANSMISSIONS
 Owner Type: Private
 Operator Name: AAMCO TRANSMISSIONS
 Operator Type: Private
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000446219	DIST/DIR: 0.040 NE	ELEVATION: 18	MAP ID: E42

NAME: AAMCO TRANSMISSIONS

Rev: 09/13/2021

ADDRESS: 131 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYD986905693

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Hazardous Waste Summary:
Waste Code: D001
Waste Description: IGNITABLE WASTE

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000446219 **DIST/DIR:** 0.040 NE **ELEVATION:** 18 **MAP ID:** E42

NAME: AAMCO TRANSMISSIONS

Rev: 09/13/2021

ADDRESS: 131 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYD986905693

SOURCE: US Environmental Protection Agency

Handler - Owner Operator:

Owner/Operator Indicator: Owner

Owner/Operator Name: AAMCO TRANSMISSIONS

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: NOT REQUIRED

Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999

Owner/Operator Telephone: 212-555-1212

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: AAMCO TRANSMISSIONS

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: NOT REQUIRED

Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999

Owner/Operator Telephone: 212-555-1212

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: AAMCO TRANSMISSIONS

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: NOT REQUIRED

Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999

Owner/Operator Telephone: 212-555-1212

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20060101

Handler Name: AAMCO TRANSMISSIONS

Federal Waste Generator Description: Not a generator, verified

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000446219 **DIST/DIR:** 0.040 NE **ELEVATION:** 18 **MAP ID:** E42

NAME: AAMCO TRANSMISSIONS

Rev: 09/13/2021

ADDRESS: 131 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYD986905693

SOURCE: US Environmental Protection Agency

Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: AAMCO TRANSMISSIONS
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19900625
Handler Name: AAMCO TRANSMISSIONS
Federal Waste Generator Description: Not reported
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1012184899 **DIST/DIR:** 0.040 NE **ELEVATION:** 18 **MAP ID:** E43

NAME: CON EDISON - MANHOLE 21953

Rev: 09/13/2021

ADDRESS: F/O 131 BRUCKNER BLVD BETWEEN
BRONX, NY 10451
BRONX

ID/Status: NYP004152963

SOURCE: US Environmental Protection Agency

RCRA-LQG:

Date Form Received by Agency: 20080221

Handler Name: CON EDISON - MANHOLE 21953

Handler Address: F/O 131 BRUCKNER BLVD BETWEEN

Handler City,State,Zip: BRONX, NY 10451

EPA ID: NYP004152963

Contact Name: FRANKLIN MURRAY

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-2808

Contact Fax: Not reported

Contact Email: MURRAYFR@CONED.COM

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Large Quantity Generator

Non-Notifier: Not reported

Biennial Report Cycle: 2007

Accessibility: Not reported

Active Site Indicator: Handler Activities

State District Owner: Not reported

State District: Not reported

Mailing Address: 4 IRVING PLACE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Owner Type: Private

Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Operator Type: Private

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1012184899 **DIST/DIR:** 0.040 NE **ELEVATION:** 18 **MAP ID:** E43

NAME: CON EDISON - MANHOLE 21953

Rev: 09/13/2021

ADDRESS: F/O 131 BRUCKNER BLVD BETWEEN
BRONX, NY 10451
BRONX

ID/Status: NYP004152963

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Biennial: List of Years
Year: 2007

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1012184899 **DIST/DIR:** 0.040 NE **ELEVATION:** 18 **MAP ID:** E43

NAME: CON EDISON - MANHOLE 21953

Rev: 09/13/2021

ADDRESS: F/O 131 BRUCKNER BLVD BETWEEN
BRONX, NY 10451
BRONX

ID/Status: NYP004152963

SOURCE: US Environmental Protection Agency

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code: D008

Waste Description: LEAD

Handler - Owner Operator:

Owner/Operator Indicator: Owner

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20070819

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20070819

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20080221

Handler Name: CON EDISON - MANHOLE 21953

Federal Waste Generator Description: Large Quantity Generator

State District Owner: Not reported

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: Yes

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1012184899 **DIST/DIR:** 0.040 NE **ELEVATION:** 18 **MAP ID:** E43

NAME: CON EDISON - MANHOLE 21953

Rev: 09/13/2021

ADDRESS: F/O 131 BRUCKNER BLVD BETWEEN
BRONX, NY 10451
BRONX

ID/Status: NYP004152963

SOURCE: US Environmental Protection Agency

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 221122

NAICS Description: ELECTRIC POWER DISTRIBUTION

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S118262224 **DIST/DIR:** 0.040 NE **ELEVATION:** 18 **MAP ID:** E44

NAME: STREET

Rev: 08/09/2021

ADDRESS: 131 BRUCKNER BLVD.
BRONX, NY
KINGS

ID/Status: 1507086 / 2015-10-06
ID/Status: 514542
ID/Status: 2015-10-06

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: STREET

Address: 131 BRUCKNER BLVD.

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 1507086 / 2015-10-06

Facility ID: 1507086

Facility Type: ER

DER Facility ID: 469005

Site ID: 514542

DEC Region: 2

Spill Cause: Traffic Accident

Spill Class: C4

SWIS: 2401

Spill Date: 2015-10-06

Investigator: TJDEMEO

Referred To: Not reported

Reported to Dept: 2015-10-06

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial Vehicle

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2015-10-06

Spill Record Last Update: 2015-10-06

Spiller Name: MITCH DELIROD

Spiller Company: UNKNOWN

Spiller Address: 131 BRUCKNER BLVD.

Spiller Company: 999

Contact Name: MITCH DELIROD

DEC Memo: "10/6/15 TJD Teleconference with FDNY HazMat. MVA between truck and car. 100 gallons lost to roadway from saddle tank. Product recovered by FDNY. NYC Sanitation responded to sand/sweep roadway. DEP notified of minor impacts to nearby sewers. FDNY had already left scene at time of notification. No further action required. Spill closed."

Remarks: "caller unsure how much may have gone into the sewer."

All Materials:

Site ID: 514542

Operable Unit ID: 1263733

Operable Unit: 01

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S118262224	DIST/DIR:	0.040 NE	ELEVATION:	18	MAP ID:	E44

NAME: STREET

Rev: 08/09/2021

ADDRESS: 131 BRUCKNER BLVD.
BRONX, NY
KINGS

ID/Status: 1507086 / 2015-10-06
ID/Status: 514542
ID/Status: 2015-10-06

SOURCE: NY Department of Environmental Conservation

Material ID: 2267479
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 100.00
Units: G
Recovered: Not reported
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104789517 **DIST/DIR:** 0.044 SSE **ELEVATION:** 19 **MAP ID:** F45

NAME: MANHOLE #29292

Rev: 08/09/2021

ADDRESS: E 132ND ST & ST ANNES AVE
BRONX, NY
BRONX

ID/Status: 0007008 / 2001-11-27

ID/Status: 75151

ID/Status: 2000-09-13

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE #29292

Address: E 132ND ST & ST ANNES AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0007008 / 2001-11-27

Facility ID: 0007008

Facility Type: ER

DER Facility ID: 70401

Site ID: 75151

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2000-09-13

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 2000-09-13

CID: 252

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2000-09-13

Spill Record Last Update: 2001-11-27

Spiller Name: UNKNOWN

Spiller Company: Unknown

Spiller Address: UNKNOWN

Spiller Company: 999

Contact Name: TED ROBICHAUD

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL Con Ed e2mis #133385 Notes: 9-13-00 A sheen on top of

1000gal water in manhole 29292. Checked conduit plate, no

sewer/drains affected. 9-14-00 1000gal water removed. No sheen or oil

present when water was removed from manhole. Corporate tanker removed

water. Sample result is <1ppm PCB. "

Remarks: "NO SEWERS OR WATERWAYS- SAMPLE TAKEN-CLEANUP PENDING RESULTS. CON ED
#133385."

All Materials:

Site ID: 75151

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104789517 **DIST/DIR:** 0.044 SSE **ELEVATION:** 19 **MAP ID:** F45

NAME: MANHOLE #29292

Rev: 08/09/2021

ADDRESS: E 132ND ST & ST ANNES AVE
BRONX, NY
BRONX

ID/Status: 0007008 / 2001-11-27

ID/Status: 75151

ID/Status: 2000-09-13

SOURCE: NY Department of Environmental Conservation

Operable Unit ID: 829831

Operable Unit: 01

Material ID: 548111

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104509853 **DIST/DIR:** 0.044 SSE **ELEVATION:** 19 **MAP ID:** F46

NAME: MANHOLE 6019

Rev: 08/09/2021

ADDRESS: 132ND ST & ST ANNES
BRONX, NY
BRONX

ID/Status: 9912889 / 2003-07-10

ID/Status: 264430

ID/Status: 2000-02-12

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 6019

Address: 132ND ST & ST ANNES

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9912889 / 2003-07-10

Facility ID: 9912889

Facility Type: ER

DER Facility ID: 215528

Site ID: 264430

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 2000-02-12

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 2000-02-12

CID: 388

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2000-02-12

Spill Record Last Update: 2003-07-10

Spiller Name: CALLER

Spiller Company: CON ED

Spiller Address: 4 IRVING PL

Spiller Company: 001

Contact Name: CALLER

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was O'CONNELL E2MIS 129957 02/12/00 @ 08:30 Hrs. Flush operator E. Gafur reports approx. (1) gallon of insulatum from blown joint on feeder 4X49 in manhole # 6019, Insulatum is mixed in mud on floor of manhole # 6019. Conduit plate 3-C indicates no sewer connection at this manhole. Mr. Gafur reports that the manhole was recently pumped by the Field Operations Dept. (crew reports that the water was clear, no sheen or oil was observed). water was pumped into storm drain. Operating supervisor L. Fischer has been dispatched to location to take sample and tag manhole. Clean up pending sample results.

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104509853 **DIST/DIR:** 0.044 SSE **ELEVATION:** 19 **MAP ID:** F46

NAME: MANHOLE 6019

Rev: 08/09/2021

ADDRESS: 132ND ST & ST ANNES
BRONX, NY
BRONX

ID/Status: 9912889 / 2003-07-10

ID/Status: 264430

ID/Status: 2000-02-12

SOURCE: NY Department of Environmental Conservation

02/12/00 @ 09:40 Hrs. Operating supervisor L. Fischer reports that sample taken, and environmental tag # 27061 was placed in manhole. -001 SAMPLE TYPE: OIL None <1.00 PPM 2/13/00 J. Maloney reports job 75% done, truck is loaded, will change truck and finish job 02/13/00 0854hrs. Flush crew Maloney & Rodriguez completed clean up at 0820 hrs. 1 gallon of insulatum & mud & 710 gallons of water was removed from MH 6019. Clean up method was flush truck & tanker. Tag # 27061 was removed..js 02/14/00 @ 07:15 Hrs. Operating supervisor L. Fischer reports that the clean up was finished on 2/13/00 @ 08:20 Hrs. The water and insulatum and wash water were removed by corporate tanker, the solid debris was removed by the vactor truck. Approx. 12 square yards of solid debris was removed. Mr. Fischer verified that there was no sewer connection in this manhole and that the sump pit was concrete. 10-DEC-2002 22:48 Blown Joint cut out and replaced 2/15/2000 15:37 as per Live Hold Off records. Walter Hedeman 84455 "

Remarks: "caller reports 1 gallon spill in manhole. con ed #129957. cleanup pending lab results."

All Materials:

Site ID: 264430

Operable Unit ID: 1091595

Operable Unit: 01

Material ID: 294752

Material Code: 0541A

Material Name: dielectric fluid

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104789538 **DIST/DIR:** 0.044 SSE **ELEVATION:** 19 **MAP ID:** F47

NAME: MANHOLE #29291

Rev: 08/09/2021

ADDRESS: 132ND ST & ST ANNES AV
BRONX, NY
BRONX

ID/Status: 0007026 / 2001-11-27

ID/Status: 68266

ID/Status: 2000-09-14

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE #29291

Address: 132ND ST & ST ANNES AV

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0007026 / 2001-11-27

Facility ID: 0007026

Facility Type: ER

DER Facility ID: 65067

Site ID: 68266

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2000-09-14

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 2000-09-14

CID: 390

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Local Agency

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2000-09-14

Spill Record Last Update: 2001-11-27

Spiller Name: UNKNOWN

Spiller Company: Unknown

Spiller Address: UNKNOWN

Spiller Company: 999

Contact Name: CHARLIE MCCARTHY

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL Con Ed e2mis #133396 Notes: 9-14-00 1qt unknown oil on

200gal water in manhole. Conduit plate indicates no sewer or drain

connection. Sample taken returned <1ppm PCB. 4300gal water and 1qt

oil removed from manhole. Hole was double washed with biogen."

Remarks: "1 QT OF UNK OIL ON 1000 GALS OF WATER - SAMPLE TAKEN - CLEAN UP AS
TO 50-499 PPM CON ED #133397"

All Materials:

Site ID: 68266

Operable Unit ID: 827876

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104789538 **DIST/DIR:** 0.044 SSE **ELEVATION:** 19 **MAP ID:** F47

NAME: MANHOLE #29291

Rev: 08/09/2021

ADDRESS: 132ND ST & ST ANNES AV
BRONX, NY
BRONX

ID/Status: 0007026 / 2001-11-27
ID/Status: 68266
ID/Status: 2000-09-14

SOURCE: NY Department of Environmental Conservation

Operable Unit: 01
Material ID: 548128
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104789536 **DIST/DIR:** 0.044 SSE **ELEVATION:** 19 **MAP ID:** F48

NAME: MANHOLE #29292

Rev: 08/09/2021

ADDRESS: 132ND ST & ST ANNES AV
BRONX, NY
BRONX

ID/Status: 0007024 / 2001-11-27

ID/Status: 68265

ID/Status: 2000-09-14

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE #29292

Address: 132ND ST & ST ANNES AV

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0007024 / 2001-11-27

Facility ID: 0007024

Facility Type: ER

DER Facility ID: 65067

Site ID: 68265

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2000-09-14

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 2000-09-14

CID: 390

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Local Agency

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2000-09-14

Spill Record Last Update: 2001-11-27

Spiller Name: UNKNOWN

Spiller Company: Unknown

Spiller Address: UNKNOWN

Spiller Company: 999

Contact Name: CHARLIE MCCARTHY

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL Con Ed e2mis #133397 Notes: 9-14-00 1qt unknown oil in

1000gal water. Cleanup to start as 50-499ppm PCB. 1150gal water and

1qt unknown oil removed from manhole. Hole was double washed with

slix and tanker removed liquids. Sample returned <1ppm PCB."

Remarks: "1 QT ON 200 GALS OF WATER - SAMPLE WAS TAKEN - CLEAN UP AS TO 50-499

PPM CON ED #133396"

All Materials:

Site ID: 68265

Operable Unit ID: 827873

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104789536 **DIST/DIR:** 0.044 SSE **ELEVATION:** 19 **MAP ID:** F48

NAME: MANHOLE #29292

Rev: 08/09/2021

ADDRESS: 132ND ST & ST ANNES AV
BRONX, NY
BRONX

ID/Status: 0007024 / 2001-11-27
ID/Status: 68265
ID/Status: 2000-09-14

SOURCE: NY Department of Environmental Conservation

Operable Unit: 01
Material ID: 548126
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104285049 **DIST/DIR:** 0.044 SSE **ELEVATION:** 19 **MAP ID:** F49

NAME: MANHOLE 29291

Rev: 08/09/2021

ADDRESS: E 132ND ST & ST ANNES AVE
BRONX, NY
BRONX

ID/Status: 9911291 / 2002-03-28
ID/Status: 75152
ID/Status: 1999-12-27

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 29291
Address: E 132ND ST & ST ANNES AVE
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 9911291 / 2002-03-28
Facility ID: 9911291
Facility Type: ER
DER Facility ID: 70401
Site ID: 75152
DEC Region: 2
Spill Cause: Unknown
Spill Class: C4
SWIS: 0301
Spill Date: 1999-12-27
Investigator: COMENALE
Referred To: Not reported
Reported to Dept: 1999-12-27
CID: 388
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1999-12-27
Spill Record Last Update: 2002-03-28
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller Company: 999
Contact Name: CALLER
DEC Memo: ""
Remarks: "caller reports 3 gallons unk on 300 gallons water. con ed #129399.
sample taken cleanup pending test results."

All Materials:

Site ID: 75152
Operable Unit ID: 1089977
Operable Unit: 01
Material ID: 553039
Material Code: 0066A
Material Name: unknown petroleum

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104285049 **DIST/DIR:** 0.044 SSE **ELEVATION:** 19 **MAP ID:** F49

NAME: MANHOLE 29291

Rev: 08/09/2021

ADDRESS: E 132ND ST & ST ANNES AVE
BRONX, NY
BRONX

ID/Status: 9911291 / 2002-03-28
ID/Status: 75152
ID/Status: 1999-12-27

SOURCE: NY Department of Environmental Conservation

Case No.: Not reported
Material FA: Petroleum
Quantity: 3.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901715 **DIST/DIR:** 0.047 West **ELEVATION:** 19 **MAP ID:** B50

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 520 E 132ND ST FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004765160

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150408

Handler Name: CON EDISON

Handler Address: 520 E 132ND ST FRONT OF

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004765160

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901715 **DIST/DIR:** 0.047 West **ELEVATION:** 19 **MAP ID:** B50

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 520 E 132ND ST FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004765160

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150408
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901715 **DIST/DIR:** 0.047 West **ELEVATION:** 19 **MAP ID:** B50

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 520 E 132ND ST FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004765160

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150408
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1001090487	DIST/DIR: 0.048 NNW	ELEVATION: 18	MAP ID: G51

NAME: INTREPID MAINTENANCE CORP

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYU005000484

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20070101
 Handler Name: INTREPID MAINTENANCE CORP
 Handler Address: 119 BRUCKNER BLVD
 Handler City,State,Zip: BRONX, NY 10454
 EPA ID: NYU005000484
 Contact Name: VICTOR SILVESTRE
 Contact Address: JERICHO TNP
 Contact City,State,Zip: JERICHO, NY 11753
 Contact Telephone: 718-402-3908
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Not reported
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R2
 Mailing Address: JERICHO TNP
 Mailing City,State,Zip: JERICHO, NY 11753
 Owner Name: BILL WOLF PETROLEUM CORP
 Owner Type: Private
 Operator Name: BILL WOLF PETROLEUM CORP
 Operator Type: Private
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1001090487 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G51

NAME: INTREPID MAINTENANCE CORP

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYU005000484

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Hazardous Waste Summary:
Waste Code: NONE
Waste Description: Not Defined

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1001090487 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G51

NAME: INTREPID MAINTENANCE CORP

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYU005000484

SOURCE: US Environmental Protection Agency

Handler - Owner Operator:

Owner/Operator Indicator: Owner

Owner/Operator Name: INTREPID MAINTENANCE CORP

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: 55 JERICHO TNP

Owner/Operator City,State,Zip: JERICHO, NY 11753

Owner/Operator Telephone: 516-997-9300

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: BILL WOLF PETROLEUM CORP

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: 55 JERICHO TNP

Owner/Operator City,State,Zip: JERICHO, NY 11753

Owner/Operator Telephone: 516-997-9300

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: INTREPID MAINTENANCE CORP

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: 55 JERICHO TNP

Owner/Operator City,State,Zip: JERICHO, NY 11753

Owner/Operator Telephone: 516-997-9300

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: BILL WOLF PETROLEUM CORP

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: 55 JERICHO TNP

Owner/Operator City,State,Zip: JERICHO, NY 11753

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1001090487 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G51

NAME: INTREPID MAINTENANCE CORP

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYU005000484

SOURCE: US Environmental Protection Agency

Owner/Operator Telephone: 516-997-9300
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: BILL WOLF PETROLEUM CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 55JERICHO TNPK
Owner/Operator City,State,Zip: JERICHO, NY 11753
Owner/Operator Telephone: 516-997-9300
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20060101
Handler Name: INTREPID MAINTENANCE CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: INTREPID MAINTENANCE CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1001090487 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G51

NAME: INTREPID MAINTENANCE CORP

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYU005000484

SOURCE: US Environmental Protection Agency

Receive Date: 19960311
Handler Name: INTREPID MAINTENANCE CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violation:
Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1001090487 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G51

NAME: INTREPID MAINTENANCE CORP

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYU005000484

SOURCE: US Environmental Protection Agency

SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:
Evaluation Date: 19960531
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2STP
Evaluation Responsible Sub-Organization: RCB
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019905380 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G52

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYP004809012

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150717

Handler Name: CON EDISON

Handler Address: 119 BRUCKNER BLVD

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004809012

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019905380 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G52

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYP004809012

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDs Where RCRA CA has Been Imposed Universe: No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150717
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019905380 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G52

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYP004809012

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150717
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-VSQG

EDR ID: 1007371418 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G53

NAME: BRUCKNER BROOK GASOLINE CORP

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10473
BRONX

ID/Status: NYR000124909

SOURCE: US Environmental Protection Agency

RCRA-VSQG:

Date Form Received by Agency: 20070101

Handler Name: BRUCKNER BROOK GASOLINE CORP

Handler Address: 119 BRUCKNER BLVD

Handler City,State,Zip: BRONX, NY 10473

EPA ID: NYR000124909

Contact Name: ADAM WOLF

Contact Address: JERICHO TNPK

Contact City,State,Zip: JERICHO, NY 11757

Contact Telephone: 516-997-9300

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Handler Activities

State District Owner: NY

State District: NYSDEC R2

Mailing Address: JERICHO TNPK

Mailing City,State,Zip: JERICHO, NY 11757

Owner Name: NO NAME FOUND

Owner Type: Private

Operator Name: NO NAME FOUND

Operator Type: Private

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-VSQG

EDR ID: 1007371418 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G53

NAME: BRUCKNER BROOK GASOLINE CORP

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10473
BRONX

ID/Status: NYR000124909

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Hazardous Waste Summary:

Waste Code: D001

Waste Description: IGNITABLE WASTE

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-VSQG

EDR ID: 1007371418 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G53

NAME: BRUCKNER BROOK GASOLINE CORP

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10473
BRONX

ID/Status: NYR000124909

SOURCE: US Environmental Protection Agency

Handler - Owner Operator:

Owner/Operator Indicator: Operator

Owner/Operator Name: BP AMOCO

Legal Status: Private

Date Became Current: 20040525

Date Ended Current: Not reported

Owner/Operator Address: Not reported

Owner/Operator City,State,Zip: Not reported

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: NO NAME FOUND

Legal Status: Private

Date Became Current: 20040525

Date Ended Current: Not reported

Owner/Operator Address: Not reported

Owner/Operator City,State,Zip: Not reported

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: NO NAME FOUND

Legal Status: Private

Date Became Current: 20040525

Date Ended Current: Not reported

Owner/Operator Address: Not reported

Owner/Operator City,State,Zip: Not reported

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: ADAM WOLF

Legal Status: Private

Date Became Current: 20040525

Date Ended Current: Not reported

Owner/Operator Address: Not reported

Owner/Operator City,State,Zip: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-VSQQ

EDR ID: 1007371418 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G53

NAME: BRUCKNER BROOK GASOLINE CORP

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10473
BRONX

ID/Status: NYR000124909

SOURCE: US Environmental Protection Agency

Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20060101

Handler Name: BRUCKNER BROOK GASOLINE CORP

Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

Receive Date: 20070101

Handler Name: BRUCKNER BROOK GASOLINE CORP

Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: Yes

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

Receive Date: 20040527

Handler Name: BRUCKNER BROOK GASOLINE CORP

Federal Waste Generator Description: Small Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-VSQG

EDR ID: 1007371418 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G53

NAME: BRUCKNER BROOK GASOLINE CORP

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10473
BRONX

ID/Status: NYR000124909

SOURCE: US Environmental Protection Agency

List of NAICS Codes and Descriptions:

NAICS Code: 811111

NAICS Description: GENERAL AUTOMOTIVE REPAIR

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

UST:

Name: SHELL SERVICE STATION
Address: 119 BRUCKNER BOULEVARD
City,State,Zip: BRONX, NY 10454
Id/Status: 2-509043 / Active
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: 01/24/2026
UTM X: 590965.72719
UTM Y: 4517645.28738
Site Type: Retail Gasoline Sales

Affiliation Records:

Site Id: 21734
Affiliation Type: Mail Contact
Company Name: BRUCKNER BROOK GASOLINE CORP.
Contact Type: Not reported
Contact Name: ADAM WOLF
Address1: 100 JERICHO QUADRANGLE
Address2: SUITE 209
City: JERICHO
State: NY
Zip Code: 11753
Country Code: 001
Phone: (516) 997-9300
Email: AWOLF@BWPETROLEUM.COM
Fax Number: Not reported
Modified By: LXZIELIN
Date Last Modified: 2020-04-22

Site Id: 21734
Affiliation Type: Emergency Contact
Company Name: BRUCKNER BROOK GASOLINE CORPORATION
Contact Type: Not reported
Contact Name: ADAM WOLF
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (516) 997-9300
Email: Not reported
Fax Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Modified By: LXZIELIN
Date Last Modified: 2020-04-22

Site Id: 21734
Affiliation Type: Facility Owner
Company Name: BRUCKNER BROOK GASOLINE CORPORATION
Contact Type: OFFICER
Contact Name: ADAM WOLF
Address1: 100 JERICO QUADRANGLE SUITE 209
Address2: Not reported
City: JERICO
State: NY
Zip Code: 11753
Country Code: 001
Phone: (516) 997-9300
Email: Not reported
Fax Number: Not reported
Modified By: JSMACRI
Date Last Modified: 2021-01-14

Site Id: 21734
Affiliation Type: Facility Operator
Company Name: SHELL SERVICE STATION
Contact Type: Not reported
Contact Name: SHAH YAFI
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 292-7917
Email: Not reported
Fax Number: Not reported
Modified By: JSMACRI
Date Last Modified: 2021-01-14

Tank Info:

Tank Number: 001
Tank ID: 29275
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 4000

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Install Date: 12/01/1978
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None

Tank Number: 001
Tank ID: 39552
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 12/01/1986
Date Tank Closed: 11/13/2019
Registered: True
Tank Location: Underground
Tank Type: Fiberglass coated steel
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: 34
Date Test: 12/10/2013
Next Test Date: Not reported
Pipe Model: D
Modified By: LXZIELIN

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 DIST/DIR: 0.048 NNW ELEVATION: 18 MAP ID: G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S Rev: 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Last Modified: 04/22/2020

Equipment Records:

L07 - Piping Leak Detection - Pressurized Piping Leak Detector
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
G04 - Tank Secondary Containment - Double-Walled (Underground)
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
L99 - Piping Leak Detection - Other

Tank Number: 002
Tank ID: 29276
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None

Tank Number: 002
Tank ID: 39553
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 12/01/1986
Date Tank Closed: 11/13/2019
Registered: True
Tank Location: Underground
Tank Type: Fiberglass coated steel
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: 34
Date Test: 12/10/2013
Next Test Date: Not reported
Pipe Model: D
Modified By: LXZIELIN
Last Modified: 04/22/2020

Equipment Records:
J01 - Dispenser - Pressurized Dispenser
E04 - Piping Secondary Containment - Double walled UG
F04 - Pipe External Protection - Fiberglass
C02 - Pipe Location - Underground/On-ground
G04 - Tank Secondary Containment - Double-Walled (Underground)
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
K01 - Spill Prevention - Catch Basin
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
B04 - Tank External Protection - Fiberglass
L99 - Piping Leak Detection - Other
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
L07 - Piping Leak Detection - Pressurized Piping Leak Detector

Tank Number: 003
Tank ID: 29277
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping

Tank Number: 003
Tank ID: 39554
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 12/01/1973
Date Tank Closed: 11/13/2019
Registered: True
Tank Location: Underground
Tank Type: Fiberglass coated steel
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: 34
Date Test: 12/10/2013
Next Test Date: Not reported
Pipe Model: D
Modified By: LXZIELIN

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Last Modified: 04/22/2020

Equipment Records:

L99 - Piping Leak Detection - Other
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
B02 - Tank External Protection - Original Sacrificial Anode
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
B08 - Tank External Protection - Retrofitted Impressed Current
H05 - Tank Leak Detection - In-Tank System (ATG)

Tank Number: 004
Tank ID: 29278
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None

Tank Number: 004
Tank ID: 39555
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: 12/01/1973
Date Tank Closed: 12/18/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 09
Date Test: 04/01/1998
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: LXZIELIN
Last Modified: 04/14/2017

Equipment Records:
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
I05 - Overfill - Vent Whistle
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None

Tank Number: 005
Tank ID: 39556
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: 12/01/1973
Date Tank Closed: 08/01/2000
Registered: True

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0022
Common Name of Substance: Waste Oil/Used Oil

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: LXZIELIN
Last Modified: 04/14/2017

Equipment Records:
I05 - Overfill - Vent Whistle
G00 - Tank Secondary Containment - None
J00 - Dispenser - None
C01 - Pipe Location - Aboveground
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None

Tank Number: 005
Tank ID: 29279
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
H00 - Tank Leak Detection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

I00 - Overfill - None
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel

Tank Number: 006
Tank ID: 29280
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None

Tank Number: 006
Tank ID: 286591
Tank Status: In Service

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Material Name: In Service

Capacity Gallons: 12000

Install Date: 01/24/2020

Date Tank Closed: Not reported

Registered: True

Tank Location: Underground

Tank Type: Equivalent technology

Tightness Test Method: -

Date Test: Not reported

Next Test Date: Not reported

Pipe Model: Not reported

Modified By: JSMACRI

Last Modified: 01/14/2021

Equipment Records:

J01 - Dispenser - Pressurized Dispenser
E04 - Piping Secondary Containment - Double walled UG
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
A00 - Tank Internal Protection - None
K01 - Spill Prevention - Catch Basin
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
G04 - Tank Secondary Containment - Double-Walled (Underground)
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
H05 - Tank Leak Detection - In-Tank System (ATG)
I02 - Overfill - High Level Alarm

Tank Number: 007

Tank ID: 29281

Tank Status: Closed - In Place

Material Name: Closed - In Place

Capacity Gallons: 550

Install Date: 12/01/1961

Date Tank Closed: Not reported

Registered: True

Tank Location: Underground

Tank Type: Steel/carbon steel

Material Code: 0009

Common Name of Substance: Gasoline

Tightness Test Method: NN

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 DIST/DIR: 0.048 NNW ELEVATION: 18 MAP ID: G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S Rev: 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: 007A
Tank ID: 286592
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 8000
Install Date: 01/24/2020
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: JSMACRI
Last Modified: 01/14/2021

Equipment Records:

H05 - Tank Leak Detection - In-Tank System (ATG)
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
G04 - Tank Secondary Containment - Double-Walled (Underground)
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

Tank Number: 007B
Tank ID: 286593
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 01/24/2020
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: JSMACRI
Last Modified: 01/14/2021

Equipment Records:
H05 - Tank Leak Detection - In-Tank System (ATG)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 008
Tank ID: 29282
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Tank Number: 009
Tank ID: 29283
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 010
Tank ID: 29284
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021

ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Tank Number: 011
Tank ID: 29285
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Affiliation Records:
Site Id: 5133
Affiliation Type: Facility Operator
Company Name: MOBIL S/S 17-634 BRUCKNER S/S
Contact Type: Not reported
Contact Name: J SOTO
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (212) 590-7559
EMail: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 5133
Affiliation Type: Emergency Contact
Company Name: MOBIL OIL CORP;ATT:A.J.PRINGLE
Contact Type: Not reported
Contact Name: J SOTO
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (212) 590-7559
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 5133
Affiliation Type: Facility Owner
Company Name: MOBIL OIL CORP;ATT:A.J.PRINGLE
Contact Type: Not reported
Contact Name: Not reported
Address1: 3225 GALLOWES RD.; ENV.ENGINEER
Address2: Not reported
City: FAIRFAX
State: VA
Zip Code: 22037
Country Code: 001
Phone: (703) 849-5862
EMail: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 2010-03-10

Site Id: 5133
Affiliation Type: Mail Contact
Company Name: MOBIL OIL CORP;ATT:A.J.PRINGLE
Contact Type: Not reported
Contact Name: Not reported
Address1: 3225 GALLOWES RD.; ENV.ENGINEER
Address2: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

City: FAIRFAX
State: VA
Zip Code: 22037
Country Code: 001
Phone: (703) 849-5862
EMail: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 2010-03-10

Tank Info:

Tank Number: 001
Tank ID: 29275
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 4000
Install Date: 12/01/1978
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None

Tank Number: 001

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tank ID: 39552
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 12/01/1986
Date Tank Closed: 11/13/2019
Registered: True
Tank Location: Underground
Tank Type: Fiberglass coated steel
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: 34
Date Test: 12/10/2013
Next Test Date: Not reported
Pipe Model: D
Modified By: LXZIELIN
Last Modified: 04/22/2020

Equipment Records:
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
G04 - Tank Secondary Containment - Double-Walled (Underground)
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
L99 - Piping Leak Detection - Other

Tank Number: 002
Tank ID: 29276
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None

Tank Number: 002
Tank ID: 39553
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 12/01/1986
Date Tank Closed: 11/13/2019
Registered: True
Tank Location: Underground
Tank Type: Fiberglass coated steel
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: 34
Date Test: 12/10/2013
Next Test Date: Not reported
Pipe Model: D
Modified By: LXZIELIN
Last Modified: 04/22/2020

Equipment Records:
J01 - Dispenser - Pressurized Dispenser
E04 - Piping Secondary Containment - Double walled UG
F04 - Pipe External Protection - Fiberglass

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

C02 - Pipe Location - Underground/On-ground
G04 - Tank Secondary Containment - Double-Walled (Underground)
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
K01 - Spill Prevention - Catch Basin
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
B04 - Tank External Protection - Fiberglass
L99 - Piping Leak Detection - Other
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
L07 - Piping Leak Detection - Pressurized Piping Leak Detector

Tank Number: 003
Tank ID: 29277
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping

Tank Number: 003

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tank ID: 39554
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 12/01/1973
Date Tank Closed: 11/13/2019
Registered: True
Tank Location: Underground
Tank Type: Fiberglass coated steel
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: 34
Date Test: 12/10/2013
Next Test Date: Not reported
Pipe Model: D
Modified By: LXZIELIN
Last Modified: 04/22/2020

Equipment Records:
L99 - Piping Leak Detection - Other
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
B02 - Tank External Protection - Original Sacrificial Anode
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
A03 - Tank Internal Protection - Fiberglass Liner (FRP)
B08 - Tank External Protection - Retrofitted Impressed Current
H05 - Tank Leak Detection - In-Tank System (ATG)

Tank Number: 004
Tank ID: 29278
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None

Tank Number: 004
Tank ID: 39555
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: 12/01/1973
Date Tank Closed: 12/18/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 09
Date Test: 04/01/1998
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: LXZIELIN
Last Modified: 04/14/2017

Equipment Records:
F00 - Pipe External Protection - None
B00 - Tank External Protection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021

ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

I05 - Overfill - Vent Whistle
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None

Tank Number: 005
Tank ID: 39556
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: 12/01/1973
Date Tank Closed: 08/01/2000
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0022
Common Name of Substance: Waste Oil/Used Oil

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: LXZIELIN
Last Modified: 04/14/2017

Equipment Records:
I05 - Overfill - Vent Whistle
G00 - Tank Secondary Containment - None
J00 - Dispenser - None
C01 - Pipe Location - Aboveground
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None

Tank Number: 005
Tank ID: 29279
Tank Status: Closed - In Place
Material Name: Closed - In Place

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S

Rev: 06/21/2021

ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel

Tank Number: 006
Tank ID: 29280
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 DIST/DIR: 0.048 NNW ELEVATION: 18 MAP ID: G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S Rev: 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None

Tank Number: 006
Tank ID: 286591
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 12000
Install Date: 01/24/2020
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: JSMACRI
Last Modified: 01/14/2021

Equipment Records:

J01 - Dispenser - Pressurized Dispenser
E04 - Piping Secondary Containment - Double walled UG
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
A00 - Tank Internal Protection - None
K01 - Spill Prevention - Catch Basin
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
G04 - Tank Secondary Containment - Double-Walled (Underground)
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
H05 - Tank Leak Detection - In-Tank System (ATG)

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

I02 - Overfill - High Level Alarm

Tank Number: 007
Tank ID: 29281
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: 007A
Tank ID: 286592
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 8000
Install Date: 01/24/2020
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: JSMACRI
Last Modified: 01/14/2021

Equipment Records:
H05 - Tank Leak Detection - In-Tank System (ATG)
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
G04 - Tank Secondary Containment - Double-Walled (Underground)
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

Tank Number: 007B
Tank ID: 286593
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 01/24/2020
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: JSMACRI
Last Modified: 01/14/2021

Equipment Records:
H05 - Tank Leak Detection - In-Tank System (ATG)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 008
Tank ID: 29282
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Tank Number: 009

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tank ID: 29283
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 010
Tank ID: 29284
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S **Rev:** 06/21/2021
ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: 011
Tank ID: 29285
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 550
Install Date: 12/01/1961
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000408093 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G54

NAME: MOBIL S/S 17-634 BRUCKNER S/S

Rev: 06/21/2021

ADDRESS: 119 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1014926432 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G55

NAME: CON EDISON MANHOLE 21948

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYP004241899

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20111014

Handler Name: CON EDISON MANHOLE 21948

Handler Address: 119 BRUCKNER BLVD

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004241899

Contact Name: GINO FRABASILE

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 914-925-6219

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: SR SPECIALIST

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: 4 IRVING PL, RM 828

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1014926432 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G55

NAME: CON EDISON MANHOLE 21948

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYP004241899

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20111206
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20110914
Handler Name: CON EDISON MANHOLE 21948

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1014926432 **DIST/DIR:** 0.048 NNW **ELEVATION:** 18 **MAP ID:** G55

NAME: CON EDISON MANHOLE 21948

Rev: 09/13/2021

ADDRESS: 119 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYP004241899

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

Receive Date: 20111014

Handler Name: CON EDISON MANHOLE 21948

Federal Waste Generator Description: Not a generator, verified

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: Yes

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

VCP

EDR ID:	S118943434	DIST/DIR:	0.055 WNW	ELEVATION:	19	MAP ID:	H56

NAME: 82 BROWN PLACE

Rev: 08/09/2021

ADDRESS: 82 BROWN PLACE
NEW YORK CITY, NY

SOURCE: NY Department of Environmental Conservation

VCP NYC:

Project ID: 13TMP0078X, 13EH-N078X, 15CVCP042X

Name: 82 BROWN PLACE

Address: 82 BROWN PLACE

City,State,Zip: NEW YORK CITY, NY

Borough: Bronx

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

SWF/LF

EDR ID: S123680460 **DIST/DIR:** 0.055 East **ELEVATION:** 18 **MAP ID:** I57

NAME: HARLEM RIVER YARD TS **Rev:** 03/31/2021

ADDRESS: ST. ANN'S & LINCOLN AVE AT 132 STREET
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

SWF/LF:

Name: HARLEM RIVER YARD TS
Address: ST. ANN'S & LINCOLN AVE AT 132 STREET
City,State,Zip: BRONX, NY 10454
Flag: INACTIVE
Region Code: 2
Phone Number: Not reported
Owner Name: Not reported
Owner Type: Not reported
Owner Address: Not reported
Owner Addr2: Not reported
Owner City,St,Zip: Not reported
Owner Email: Not reported
Owner Phone: Not reported
Contact Name: Not reported
Contact Address: Not reported
Contact Addr2: Not reported
Contact City,St,Zip: Not reported
Contact Email: Not reported
Contact Phone: Not reported
Activity Desc: Transfer station - permit
Activity Number: [03T25]
Active: No
East Coordinate: 591100
North Coordinate: 4517500
Accuracy Code: Not reported
Regulatory Status: None
Waste Type: Not reported
Authorization #: 0
Authorization Date: Not reported
Expiration Date: Not reported
Operator Name: Not reported
Operator Type: Not reported
Last Date: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1001171453 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J58

NAME: SHELL SERVICE STATION

Rev: 09/13/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NY0001493014

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20190208

Handler Name: SHELL SERVICE STATION

Handler Address: 114 BRUCKNER BLVD

Handler City,State,Zip: BRONX, NY 10454-4516

EPA ID: NY0001493014

Contact Name: Not reported

Contact Address: JERICHO PLZ SUITE 500W

Contact City,State,Zip: JERICHO, NY 11753

Contact Telephone: Not reported

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: JERICHO PLZ SUITE 500W

Mailing City,State,Zip: JERICHO, NY 11753

Owner Name: SHELL OIL PRODUCTS CO

Owner Type: Private

Operator Name: SHELL OIL PRODUCTS CO

Operator Type: Private

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1001171453 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J58

NAME: SHELL SERVICE STATION

Rev: 09/13/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NY0001493014

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20190208
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: No
Manifest Broker: No
Sub-Part P Indicator: No

Hazardous Waste Summary:
Waste Code: D001
Waste Description: IGNITABLE WASTE

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1001171453 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J58

NAME: SHELL SERVICE STATION

Rev: 09/13/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NY0001493014

SOURCE: US Environmental Protection Agency

Waste Code: D008
Waste Description: LEAD

Waste Code: D018
Waste Description: BENZENE

Handler - Owner Operator:
Owner/Operator Indicator: Operator
Owner/Operator Name: SHELL OIL PRODUCTS CO
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 30 JERICHO PLZ SUITE 500W
Owner/Operator City,State,Zip: JERICHO, NY 11753
Owner/Operator Telephone: 516-365-2489
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SHELL OIL PRODUCTS CO
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 30 JERICHO PLZ SUITE 500W
Owner/Operator City,State,Zip: JERICHO, NY 11753
Owner/Operator Telephone: 516-365-2489
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SHELL OIL PRODUCTS CO
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 30 JERICHO PLZ SUITE 500W
Owner/Operator City,State,Zip: JERICHO, NY 11753
Owner/Operator Telephone: 516-365-2489
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1001171453 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J58

NAME: SHELL SERVICE STATION

Rev: 09/13/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NY0001493014

SOURCE: US Environmental Protection Agency

Owner/Operator Name: SHELL OIL PRODUCTS CO
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 30 JERICHO PLZ SUITE 500W
Owner/Operator City,State,Zip: JERICHO, NY 11753
Owner/Operator Telephone: 516-365-2489
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SHELL OIL PRODUCTS CO
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 30 JERICHO PLZ SUITE 500W
Owner/Operator City,State,Zip: JERICHO, NY 11753
Owner/Operator Telephone: 516-365-2489
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20190208
Handler Name: SHELL SERVICE STATION
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 19990708
Handler Name: SHELL SERVICE STATION
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1001171453 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J58

NAME: SHELL SERVICE STATION

Rev: 09/13/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NY0001493014

SOURCE: US Environmental Protection Agency

Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: SHELL SERVICE STATION
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: SHELL SERVICE STATION
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19970702
Handler Name: SHELL SERVICE STATION
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1001171453 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J58

NAME: SHELL SERVICE STATION

Rev: 09/13/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NY0001493014

SOURCE: US Environmental Protection Agency

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: 1001171453	DIST/DIR: 0.057 NW	ELEVATION: 19	MAP ID: J58

NAME: SHELL SERVICE STATION

Rev: 08/09/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0013495 / 2002-07-11
ID/Status: 0303604 / 2009-12-07
ID/Status: 0203687 / 2004-10-25
ID/Status: 292389
ID/Status: 292390

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: SHELL STATION
Address: 114 BRUCKNER BOULEVARD
City,State,Zip: BRONX, NY 10454
Spill Number/Closed Date: 0013495 / 2002-07-11
Facility ID: 0013495
Facility Type: ER
DER Facility ID: 5904
Site ID: 292389
DEC Region: 2
Spill Cause: Unknown
Spill Class: B3
SWIS: 0301
Spill Date: 2001-03-26
Investigator: KMFOLEY
Referred To: Not reported
Reported to Dept: 2001-03-26
CID: 207
Water Affected: Not reported
Spill Source: Gasoline Station or other PBS Facility
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2001-03-26
Spill Record Last Update: 2005-07-20
Spiller Name: ROB RULE
Spiller Company: SHELL EQUIVA SERVICES LLC
Spiller Address: PO BOX 1243
Spiller Company: 001
Contact Name: MATT SCHNECK
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was K FOLEY 7/11/2002 - Spill Status switched to No Further Action If this property use is ever changed in the future, Equiva/Shell will be responsible for remediating the Hot Spots which remain on the site. 8/25/2003 - Shell pulled all tanks, dispensers, pipes etc. Report prepared by Northeast Environmental Solutions Inc. showed clean endpoints after excavation work. DEC requested a water sample in order to give closure. 12/1/03 Reassigned from Sangesland to K Foley. Reference #0303604, 9801880, 9413289."
Remarks: "contaminated soil found underneath dispensers soil borings to be

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: 1001171453 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J58

NAME: SHELL SERVICE STATION

Rev: 08/09/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0013495 / 2002-07-11
ID/Status: 0303604 / 2009-12-07
ID/Status: 0203687 / 2004-10-25
ID/Status: 292389
ID/Status: 292390

SOURCE: NY Department of Environmental Conservation

performed"

All Materials:
Site ID: 292389
Operable Unit ID: 834974
Operable Unit: 01
Material ID: 540205
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: SHELL STATION #138576
Address: 114 BRUCKNER BOULEVARD
City,State,Zip: BRONX, NY 10454
Spill Number/Closed Date: 0303604 / 2009-12-07
Facility ID: 0303604
Facility Type: ER
DER Facility ID: 5904
Site ID: 292390
DEC Region: 2
Spill Cause: Deliberate
Spill Class: C4
SWIS: 0301
Spill Date: 2003-07-07
Investigator: AAOBLIGA
Referred To: NFA
Reported to Dept: 2003-07-07
CID: 216
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2003-07-07
Spill Record Last Update: 2009-12-07

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: 1001171453	DIST/DIR: 0.057 NW	ELEVATION: 19	MAP ID: J58

NAME: SHELL SERVICE STATION

Rev: 08/09/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0013495 / 2002-07-11
ID/Status: 0303604 / 2009-12-07
ID/Status: 0203687 / 2004-10-25
ID/Status: 292389
ID/Status: 292390

SOURCE: NY Department of Environmental Conservation

Spiller Name: UNK

Spiller Company: SHELL

Spiller Address: 114 BRUCKNER BLVD

Spiller Company: 001

Contact Name: ROB E RULE

DEC Memo: "PBS #2-190802 Reference spill #s 9413289, 9801880, 0013495.

8/22/2003 Matt Schneck from Northeast Environmental Solutions, Inc. submitted a Closure report dated August 8, 2003. The report details removal of USTs, dispenser islands, hydraulic lifts and product piping. Digging down to bedrock, endpoint soil samples taken at bedrock interface. No groundwater samples were taken. 8/25/2003 DEC requested a groundwater sample from the site. 1/5/03 Reassigned from Sangesland to Foley. Added gasoline to material spilled due to TAGM exceedances from spills 0013495, 9801880, 9413289. Received well-installation report dated 12/30/03 from NES. Installed three monitoring wells. MW-1, in vicinity of former 550s, identified BTEX/MTBE at 5864ppb/3100ppb on 10/10/03. 5/18/04 Update report received (NES, 5/12/04). BTEX range from ND(MW-2, MW-3) to 7473ppb(MW-1). MTBE from 0.7ppb(MW-3) to 1380ppb(MW-1). Need further groundwater delineation around MW-1. 7/22/04 Requested delineation around tank field/MW-1. M. Schneck, NES, will prepare map with proposed locations for Dept review. 7/28/04 Received update report with well installation proposal. 8/9/04 Sent access letters for installation of wells at 112 and 115 Bruckner Blvd. 9/8/04 M. Schneck notified Dept of drilling to be done 9/13-9/14. 11/23/04 Met with M. Schneck, NES and R. Rule, Shell. Update report received. 2 offsite wells drilled 9/13 & 9/22. No soil contamination detected. Seeing mounding in MW-3 probably due to backfill by coarse gravel. MW-6 is crossgradient and showing some BTEX(711ppb) but no MTBE. MW-6 has a high benzene(511ppb) to xylenes(90ppb) ratio while MW-1 has low benzene(60ppb) to xylenes(2080ppb) ratio. Hess and Amoco nearby. Station no longer operating. 12/10/04 Update from M. Schneck- did some research on documented releases in the vicinity of the 114 Bruckner Blvd site that could be impacting the off-site well we installed at the NW corner of Bruckner Blvd. and Brown Place (MW-6). The Hess (former Merit at 126-128 Bruckner Blvd.) east of the site (up-gradient?) has multiple spills assigned to it. Spill # 8606553 is from a 750-gallon gasoline spill resulting from an overflow of the USTs. Spill # 9205097 was called in during UST removal activities when contaminated soil was encountered. Spill #9405017 is from another overflow, the amount of which is not specified. The Amoco(Wolf) northeast at 119 Bruckner Blvd has (2) spills associated with it, one being for an unknown amount of gasoline spilled on land (#0203687), and the other being for a used oil UST failing a tightness test (#0007588). Both spills are closed. 12/15/04 Sent

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: 1001171453	DIST/DIR: 0.057 NW	ELEVATION: 19	MAP ID: J58

NAME: SHELL SERVICE STATION

Rev: 08/09/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0013495 / 2002-07-11
ID/Status: 0303604 / 2009-12-07
ID/Status: 0203687 / 2004-10-25
ID/Status: 292389
ID/Status: 292390

SOURCE: NY Department of Environmental Conservation

email to M. Schneck. Agreed that if concentrations are consistent in next round and GW flow direction is confirmed, MW-6 can be decommissioned. 12/20/04 Email from M. Schneck received. Will schedule hi-vac on MW-1 to try to reduce concentrations. 2/8/05 Update report received. Recent GW monitoring indicates MW-6 is sidegradient from on-site well MW-1. Also, GW analytical data for off-site well MW-6 has a high benzene to xylenes ratio and MTBE concentrations below the MDL. This is inconsistent with lab data for MW-1 with low benzene to xylenes ratio and MTBE concentrations >100ppb. Requesting sampling be discontinued at MW-6. 5/19/05 Spoke to new property owner, Mr. Christopher Persheff (212-772-7550 X28), at Bradford Sweet Management LLC. He had received a stop work order from DOB which told him he had to meet DEPs requirements. I told him that he would have to comply with both DEP and DEC separately. He will be constructing a commercial building, Dunkin Donuts, on site. Shell has already removed the tanks and will be conducting gw monitoring. 5/20/05 C. Persheff sent letter stating that he spoke to M. Schneck and his tenant, Mr. Sethi. During demolition, the wells became filled with soil. His tenant will be repairing/replacing the wells at his cost. 5/31/05 Email to C. Persheff outlining requirements for investigation and RAP(to include soil samples under foundation and vapor mitigation). Stipulation due 6/15/05. Little E designated site. Callista Nazaire of DEP copied. 6/1/05 Spoke to M. Schneck, NES. Shell plans on doing the remediation. Shell will possibly sign stipulation agreement. 6/20/05 Received copy of letter from LCS (for BNS Mgmt) to D. Cabbagestalk, NYCDEP. Requesting approval to proceed with construction. 8/5/05 Received copy of letter from D. Cabbagestalk(718-595-4451), NYCDEP, which requires soil vapor investigation (2 indoor air samples from basement, 2 sub-slab samples) and specifications for vapor barrier. 9/14/05 Received copy of letter from D. Cabbagestalk, NYCDEP, to Marshall Kaminer, Bronx Borough Commissioner. Based upon analytical results for ambient indoor and outdoor air samples, NYCDEP does not object to construction. 2/1/06 Meeting with Shell, SAIC, Longshore. Will send sensitive receptor survey and model based on worst case scenario to do exposure assessment. 3 wells sampled 12/30/05. BTEX ranged from ND(MW-5,8) to 85ppb(MW-6). 3/22/06 Reassigned from Foley to Tang.(KMF) 8/22/08 - Obligado - Reassigned to Obligado as per BREvdo 12/7/09 - Obligado - Completed review of the spill file. According to previous closure reports, endpoint samples from the removal of UST and piping in 2003 were below soil cleanup criteria down to approximately 6 to 8 ft bgs in the vicinity of the tanks and dispensers and to 2 ft bgs in the vicinity of the piping and remote fills. Limited exceedences may still be present at the 4 ft interval at the remote fill based on a 2001 Soil boring investigation. HOWEVER

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: 1001171453 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J58

NAME: SHELL SERVICE STATION

Rev: 08/09/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0013495 / 2002-07-11
ID/Status: 0303604 / 2009-12-07
ID/Status: 0203687 / 2004-10-25
ID/Status: 292389
ID/Status: 292390

SOURCE: NY Department of Environmental Conservation

the 7 ft interval just above the bedrock was below SCOs. Soil impacts in the vicinity of the remote fill appears limited and does not appear to be impacted ground water quality. The most recent ground water results based on 3Q09 data had only one exceedence xylenes at 8 ug/l. MTBE was ND at all locations. After discussion with DEC Tibbe, this spill is closed. "

Remarks: "someone tipped over a drum that was stock piled spill is on the ground and will be recovered "

All Materials:

Site ID: 292390

Operable Unit ID: 871652

Operable Unit: 01

Material ID: 2106570

Material Code: 1213A

Material Name: MTBE (methyl-tert-butyl ether)

Case No.: 01634044

Material FA: Hazardous Material

Quantity: Not reported

Units: Not reported

Recovered: Not reported

Oxygenate: True

Site ID: 292390

Operable Unit ID: 871652

Operable Unit: 01

Material ID: 504469

Material Code: 0022

Material Name: waste oil/used oil

Case No.: Not reported

Material FA: Petroleum

Quantity: 50.00

Units: G

Recovered: .00

Oxygenate: True

Site ID: 292390

Operable Unit ID: 871652

Operable Unit: 01

Material ID: 504468

Material Code: 0009

Material Name: gasoline

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: 1001171453	DIST/DIR: 0.057 NW	ELEVATION: 19	MAP ID: J58

NAME: SHELL SERVICE STATION

Rev: 08/09/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0013495 / 2002-07-11
ID/Status: 0303604 / 2009-12-07
ID/Status: 0203687 / 2004-10-25
ID/Status: 292389
ID/Status: 292390

SOURCE: NY Department of Environmental Conservation

Units: G
Recovered: .00
Oxygenate: True

Name: AMOCO
Address: 114 BRUCKNER BOULEVARD
City,State,Zip: BRONX, NY 10454
Spill Number/Closed Date: 0203687 / 2004-10-25
Facility ID: 0203687
Facility Type: ER
DER Facility ID: 5904
Site ID: 163323
DEC Region: 2
Spill Cause: Equipment Failure
Spill Class: C4
SWIS: 0301
Spill Date: 2002-07-08
Investigator: KMFOLEY
Referred To: Not reported
Reported to Dept: 2002-07-08
CID: 396
Water Affected: Not reported
Spill Source: Gasoline Station or other PBS Facility
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: True
Remediation Phase: 0
Date Entered In Computer: 2002-07-08
Spill Record Last Update: 2005-07-21
Spiller Name: Not reported
Spiller Company: WOLF PETROLEUM
Spiller Address: 125 JERICHO TURNPIKE
Spiller Company: 001
Contact Name: ADAM WOLF
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was K FOLEY 1/8/04 Reassigned from Vought to K Foley. 9/29/04 Met with B. Cohen(Certilman Balin Attorneys), B. Beck(Consultant, National Env.) with J. Rommel and L. Oliva. B. Beck to provide a response by 10/15/04. See spill #0007588 for waste oil tank test failure info. 10/25/04 Received repair record and affidavit for the premium tank submersible performed by Gasoline Installations, Inc. and final

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: 1001171453 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J58

NAME: SHELL SERVICE STATION

Rev: 08/09/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0013495 / 2002-07-11
ID/Status: 0303604 / 2009-12-07
ID/Status: 0203687 / 2004-10-25
ID/Status: 292389
ID/Status: 292390

SOURCE: NY Department of Environmental Conservation

passing tightness test results prepared by Crompco. Repair affidavit signed 10/15/04 states that there was no evidence of contamination when they replaced leaking fittings at the premium submersible union 7/9/02. Tanks passed test on 7/10/02."

Remarks: "line leak...they will get a contractor to repair the leak"

All Materials:

Site ID: 163323

Operable Unit ID: 856576

Operable Unit: 01

Material ID: 521507

Material Code: 0009

Material Name: gasoline

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: 1001171453	DIST/DIR: 0.057 NW	ELEVATION: 19	MAP ID: J58

NAME: SHELL SERVICE STATION

Rev: 08/09/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 9413289 / 2003-02-25
ID/Status: 9801880 / 2003-02-25
ID/Status: 0007588 / 2004-10-25
ID/Status: 307768
ID/Status: 292391

SOURCE: NY Department of Environmental Conservation

LTANKS:

Name: SHELL GAS STATION

Address: 114 BRUCKNER BOULEVARD

City,State,Zip: BRONX, NY 10454

Spill Number/Closed Date: 9413289 / 2003-02-25

Facility ID: 9413289

Site ID: 307768

Spill Date: 1995-01-05

Spill Cause: Tank Test Failure

Spill Source: Gasoline Station or other PBS Facility

Spill Class: C3

Cleanup Ceased: Not reported

SWIS: 0301

Investigator: KMFOLEY

Referred To: Not reported

Reported to Dept: 1995-01-05

CID: Not reported

Water Affected: Not reported

Spill Notifier: Tank Tester

Last Inspection: Not reported

Recommended Penalty: False

Meets Standard: False

UST Involvement: True

Remediation Phase: 0

Date Entered In Computer: 1995-02-27

Spill Record Last Update: 2005-07-20

Spiller Name: Not reported

Spiller Company: SHELL OIL COMPANY

Spiller Address: ONE JERICHO PLAZA

Spiller County: 001

Spiller Contact: Not reported

Spiller Phone: Not reported

Spiller Extention: Not reported

DEC Region: 2

DER Facility ID: 5904

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead DEC Field was K FOLEY REPORT AND REQUEST FOR CLOSURE RECEIVED. WANT ADD'T SOILS INFORMATION. SHELL WILL DO GEOPROBE. 12/1/03 Reassigned from Sangesland to K Foley. Reference spill #s 0013495, 0303604, 9801880."

Remarks: "NON PRODUCT BEARING FAILURE, ABOVE PRODUCT LINE RECOMMENDATION, UNCOVER, ISOLATE, RE-TEST."

All TTF:

Facility ID: 9413289

Spill Number: 9413289

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: 1001171453 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J58

NAME: SHELL SERVICE STATION

Rev: 08/09/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 9413289 / 2003-02-25
ID/Status: 9801880 / 2003-02-25
ID/Status: 0007588 / 2004-10-25
ID/Status: 307768
ID/Status: 292391

SOURCE: NY Department of Environmental Conservation

Spill Tank Test: 1543503
Site ID: 307768
Tank Number: Not reported
Tank Size: 0
Material: 0009
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:
Site ID: 307768
Operable Unit ID: 1010837
Operable Unit: 01
Material ID: 372034
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: SHELL SERVICE STATION
Address: 114 BRUCKNER BOULEVARD
City,State,Zip: BRONX, NY 10454
Spill Number/Closed Date: 9801880 / 2003-02-25
Facility ID: 9801880
Site ID: 292391
Spill Date: 1998-05-05
Spill Cause: Tank Failure
Spill Source: Gasoline Station or other PBS Facility
Spill Class: B3
Cleanup Ceased: Not reported
SWIS: 0301
Investigator: KMFOLEY

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: 1001171453 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J58

NAME: SHELL SERVICE STATION

Rev: 08/09/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 9413289 / 2003-02-25
ID/Status: 9801880 / 2003-02-25
ID/Status: 0007588 / 2004-10-25
ID/Status: 307768
ID/Status: 292391

SOURCE: NY Department of Environmental Conservation

Referred To: Not reported

Reported to Dept: 1998-05-13

CID: 365

Water Affected: Not reported

Spill Notifier: Other

Last Inspection: Not reported

Recommended Penalty: False

Meets Standard: False

UST Involvement: True

Remediation Phase: 0

Date Entered In Computer: 1998-05-13

Spill Record Last Update: 2005-07-20

Spiller Name: DAVE MCNEIL

Spiller Company: SHELL

Spiller Address: 114 BRUCKNER BLVD

Spiller County: 001

Spiller Contact: DAVE MCNEIL

Spiller Phone: (516) 365-7240

Spiller Extention: Not reported

DEC Region: 2

DER Facility ID: 5904

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was K

FOLEY Reference spill #0303604, 0013495, 9413289. 12/1/03 Reassigned
from Sangesland to K Foley."

Remarks: "4 1,000 GALLON GASOLINE TANKS - DURING AN UPGRADE OF TANKS ENCOUNTER
CONTAMINATED SOIL - SOIL HAS BEEN EXCAVATED & READY FOR DISPOSAL -
CROSS REF #94014389"

All Materials:

Site ID: 292391

Operable Unit ID: 1062420

Operable Unit: 01

Material ID: 323789

Material Code: 0009

Material Name: gasoline

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Name: BRUCKNER BROOK GASOLINE C

Address: 114 BRUCKNER BOULEVARD

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: 1001171453 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J58

NAME: SHELL SERVICE STATION

Rev: 08/09/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 9413289 / 2003-02-25
ID/Status: 9801880 / 2003-02-25
ID/Status: 0007588 / 2004-10-25
ID/Status: 307768
ID/Status: 292391

SOURCE: NY Department of Environmental Conservation

City,State,Zip: BRONX, NY 10454
Spill Number/Closed Date: 0007588 / 2004-10-25
Facility ID: 0007588
Site ID: 163322
Spill Date: 2000-09-27
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: C4
Cleanup Ceased: Not reported
SWIS: 0301
Investigator: KMFOLEY
Referred To: Not reported
Reported to Dept: 2000-09-28
CID: 390
Water Affected: Not reported
Spill Notifier: Local Agency
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 2000-09-28
Spill Record Last Update: 2005-07-21
Spiller Name: BRUCE BECK
Spiller Company: WOLF PETROLEUM
Spiller Address: 119 BRUCKNER BLVD
Spiller County: 001
Spiller Contact: BRUCE BECK
Spiller Phone: (631) 226-9080
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 5904
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was K FOLEY 12/4/03 Reassigned from Sangesland to Foley. Amoco (Wolf) site. 2/24/04 File review(KMF): 2/01 UST closure report submitted by National Env. for the removal of (1) 550gal wate oil UST. 2 bottom samples and 1 sidewall composite samples were all OK for VOCs. Bottom samples had mild SVOC hits. Sidewall samples had low SVOC hits. RCRA metals OK except for lead(minor). Subsequent boring samples from 8-10' below the excavation bottom were tested for TCLP for VOC/SVOC/lead and were all below limits. No groundwater samples taken. 9/29/04 Met with B. Cohen(Certilman Balin Attorneys), B. Beck(Consultant, National Env.) with J. Rommel and L. Oliva. See spill #0203687 for gasoline TTF. B. Beck to provide a response by 10/15/04 regarding gasoline TTF. "

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: 1001171453 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J58

NAME: SHELL SERVICE STATION

Rev: 08/09/2021

ADDRESS: 114 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 9413289 / 2003-02-25

ID/Status: 9801880 / 2003-02-25

ID/Status: 0007588 / 2004-10-25

ID/Status: 307768

ID/Status: 292391

SOURCE: NY Department of Environmental Conservation

Remarks: "underground tank was overfilled or failed"

All Materials:

Site ID: 163322

Operable Unit ID: 828342

Operable Unit: 01

Material ID: 545122

Material Code: 0022

Material Name: waste oil/used oil

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000396403 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J59

NAME: SHELL SVC. STA. 138576 **Rev:** 06/21/2021

ADDRESS: 114 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

UST:

Name: SHELL SVC. STA. 138576
Address: 114 BRUCKNER BOULEVARD
City,State,Zip: BRONX, NY 10454
Id/Status: 2-190802 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: N/A
UTM X: 590913.53763
UTM Y: 4517644.04762
Site Type: Retail Gasoline Sales

Affiliation Records:

Site Id: 5911
Affiliation Type: Facility Owner
Company Name: MOTIVA ENTERPRISES LLC
Contact Type: Not reported
Contact Name: Not reported
Address1: 520 ALLENS AVE.
Address2: Not reported
City: PROVIDENCE
State: RI
Zip Code: 02905
Country Code: 001
Phone: (401) 429-2200
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 5911

Affiliation Type: Mail Contact
Company Name: PERMIT ANALYST
Contact Type: Not reported
Contact Name: SHARON IRIZARRY
Address1: MOTIVE ENTERPRISES LLC
Address2: 520 ALLENS AVENUE, BLDG. 2
City: PROVIDENCE
State: RI
Zip Code: 02905
Country Code: 001
Phone: (401) 429-2277
EMail: Not reported
Fax Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000396403 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J59

NAME: SHELL SVC. STA. 138576 **Rev:** 06/21/2021

ADDRESS: 114 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 5911
Affiliation Type: Emergency Contact
Company Name: MOTIVA ENTERPRISES LLC
Contact Type: Not reported
Contact Name: CHEM TREC
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (800) 424-9300
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 5911
Affiliation Type: Facility Operator
Company Name: SHELL SVC. STA. 138576
Contact Type: Not reported
Contact Name: ALBERTO GONZALA
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (212) 292-5225
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 001
Tank ID: 7176
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000396403 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J59

NAME: SHELL SVC. STA. 138576

Rev: 06/21/2021

ADDRESS: 114 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Install Date: 12/01/1971
Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 19
Date Test: 05/01/1998
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

D02 - Pipe Type - Galvanized Steel
K01 - Spill Prevention - Catch Basin
A01 - Tank Internal Protection - Epoxy Liner
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
F07 - Pipe External Protection - Retrofitted Sacrificial Anode
I03 - Overfill - Automatic Shut-Off
B01 - Tank External Protection - Painted/Asphalt Coating
H05 - Tank Leak Detection - In-Tank System (ATG)

Tank Number: 002
Tank ID: 7177
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 12/01/1971
Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 19
Date Test: 05/01/1998
Next Test Date: Not reported
Pipe Model: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000396403 DIST/DIR: 0.057 NW ELEVATION: 19 MAP ID: J59

NAME: SHELL SVC. STA. 138576 Rev: 06/21/2021
ADDRESS: 114 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

F07 - Pipe External Protection - Retrofitted Sacrificial Anode
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A01 - Tank Internal Protection - Epoxy Liner
K01 - Spill Prevention - Catch Basin
D02 - Pipe Type - Galvanized Steel
B01 - Tank External Protection - Painted/Asphalt Coating
I03 - Overfill - Automatic Shut-Off
H05 - Tank Leak Detection - In-Tank System (ATG)

Tank Number: 003
Tank ID: 7178
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 12/01/1972
Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 19
Date Test: 05/01/1998
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

D02 - Pipe Type - Galvanized Steel
K01 - Spill Prevention - Catch Basin
A01 - Tank Internal Protection - Epoxy Liner
F07 - Pipe External Protection - Retrofitted Sacrificial Anode
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
I03 - Overfill - Automatic Shut-Off
B01 - Tank External Protection - Painted/Asphalt Coating

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000396403 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J59

NAME: SHELL SVC. STA. 138576 **Rev:** 06/21/2021
ADDRESS: 114 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

H05 - Tank Leak Detection - In-Tank System (ATG)

Tank Number: 004
Tank ID: 7179
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: 12/01/1951
Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
H00 - Tank Leak Detection - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F01 - Pipe External Protection - Painted/Asphalt Coating

Tank Number: 005
Tank ID: 7180
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000396403 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J59

NAME: SHELL SVC. STA. 138576 **Rev:** 06/21/2021
ADDRESS: 114 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating

Tank Number: 006
Tank ID: 7181
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
D02 - Pipe Type - Galvanized Steel
H00 - Tank Leak Detection - None
I00 - Overfill - None
K01 - Spill Prevention - Catch Basin
C02 - Pipe Location - Underground/On-ground

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000396403 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J59

NAME: SHELL SVC. STA. 138576 **Rev:** 06/21/2021

ADDRESS: 114 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F01 - Pipe External Protection - Painted/Asphalt Coating

Tank Number: 007
Tank ID: 7182
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
D02 - Pipe Type - Galvanized Steel
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F01 - Pipe External Protection - Painted/Asphalt Coating

Tank Number: 008
Tank ID: 7183
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/12/2003
Registered: True

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000396403 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J59

NAME: SHELL SVC. STA. 138576 **Rev:** 06/21/2021
ADDRESS: 114 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating

Tank Number: 009
Tank ID: 7184
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
D02 - Pipe Type - Galvanized Steel
H00 - Tank Leak Detection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000396403 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J59

NAME: SHELL SVC. STA. 138576

Rev: 06/21/2021

ADDRESS: 114 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F01 - Pipe External Protection - Painted/Asphalt Coating

Tank Number: 010
Tank ID: 7185
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
D02 - Pipe Type - Galvanized Steel
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F01 - Pipe External Protection - Painted/Asphalt Coating

Tank Number: 011
Tank ID: 7186
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000396403 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J59

NAME: SHELL SVC. STA. 138576

Rev: 06/21/2021

ADDRESS: 114 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
H00 - Tank Leak Detection - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F01 - Pipe External Protection - Painted/Asphalt Coating

Tank Number: 012
Tank ID: 7187
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000396403 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J59

NAME: SHELL SVC. STA. 138576

Rev: 06/21/2021

ADDRESS: 114 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Equipment Records:

D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None

Tank Number: 013

Tank ID: 7188

Tank Status: Closed - Removed

Material Name: Closed - Removed

Capacity Gallons: 550

Install Date: Not reported

Date Tank Closed: 09/12/2003

Registered: True

Tank Location: Underground

Tank Type: Steel/carbon steel

Material Code: 9999

Common Name of Substance: Other

Tightness Test Method: NN

Date Test: Not reported

Next Test Date: Not reported

Pipe Model: Not reported

Modified By: TRANSLAT

Last Modified: 04/14/2017

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: 014

Tank ID: 7189

Tank Status: Closed - Removed

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000396403 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J59

NAME: SHELL SVC. STA. 138576 **Rev:** 06/21/2021

ADDRESS: 114 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: 015
Tank ID: 7190
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000396403 **DIST/DIR:** 0.057 NW **ELEVATION:** 19 **MAP ID:** J59

NAME: SHELL SVC. STA. 138576

Rev: 06/21/2021

ADDRESS: 114 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None

Tank Number: 016
Tank ID: 7191
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 09/12/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1014919143 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K60

NAME: CON EDISON MANHOLE 5969

Rev: 09/13/2021

ADDRESS: E132ND ST & ST ANNS AVE
BRONX, NY 10451
BRONX

ID/Status: NYP004232989

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20110428

Handler Name: CON EDISON MANHOLE 5969

Handler Address: E132ND ST & ST ANNS AVE

Handler City,State,Zip: BRONX, NY 10451

EPA ID: NYP004232989

Contact Name: DOMINIC BIZZARO

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 914-925-6219

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: SR SPECIALIST

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PLAZA RM 828

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1014919143 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K60

NAME: CON EDISON MANHOLE 5969

Rev: 09/13/2021

ADDRESS: E132ND ST & ST ANNS AVE
BRONX, NY 10451
BRONX

ID/Status: NYP004232989

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20111026
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20110329
Handler Name: CON EDISON MANHOLE 5969

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1014919143 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K60

NAME: CON EDISON MANHOLE 5969

Rev: 09/13/2021

ADDRESS: E132ND ST & ST ANNS AVE
BRONX, NY 10451
BRONX

ID/Status: NYP004232989

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

Receive Date: 20110428

Handler Name: CON EDISON MANHOLE 5969

Federal Waste Generator Description: Not a generator, verified

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: Yes

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S107521141 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K61

NAME: DRUM RUN - 11 DRUMS

Rev: 08/09/2021

ADDRESS: EAST 132ND/ST ANNES
BRONX, NY
BRONX

ID/Status: 0510669 / 2006-03-27
ID/Status: 356687
ID/Status: 2005-12-12

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: DRUM RUN - 11 DRUMS

Address: EAST 132ND/ST ANNES

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0510669 / 2006-03-27

Facility ID: 0510669

Facility Type: ER

DER Facility ID: 306749

Site ID: 356687

DEC Region: 2

Spill Cause: Abandoned Drums

Spill Class: C4

SWIS: 0301

Spill Date: 2005-12-12

Investigator: SFRAHMAN

Referred To: Not reported

Reported to Dept: 2005-12-12

CID: 444

Water Affected: Not reported

Spill Source: Institutional, Educational, Gov., Other

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2005-12-12

Spill Record Last Update: 2006-03-27

Spiller Name: GABRIEL KAPUR

Spiller Company: SIDEWALK

Spiller Address: EAST 132ND/ST ANNES

Spiller Company: 001

Contact Name: GABRIEL KAPUR

DEC Memo: "added to drum run list. 01/23/06 Sharif// Approximately 430 gallons were pumped out from all those drums on 01/20/06. Drums are located by the side walk, across the street from American Building Supply Corp who allegedly dumped all those drums after they had generated waste oil from the trucks. Case was referred to Legal. 03/15/06 Sharif Rahman- Empty drums were removed by NYC sanitation dept. "

Remarks: "11-55 GALLON DRUMS, NEED TO BE PICKED UP"

All Materials:

Site ID: 356687

Operable Unit ID: 1113984

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S107521141 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K61

NAME: DRUM RUN - 11 DRUMS

Rev: 08/09/2021

ADDRESS: EAST 132ND/ST ANNES
BRONX, NY
BRONX

ID/Status: 0510669 / 2006-03-27
ID/Status: 356687
ID/Status: 2005-12-12

SOURCE: NY Department of Environmental Conservation

Operable Unit: 01
Material ID: 2104058
Material Code: 0022
Material Name: waste oil/used oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S108466658 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K62

NAME: HARLEM RIVER YARDS SITE

Rev: 08/09/2021

ADDRESS: SAINT ANNE'S/ 132ND AVE
BRONX, NY
BRONX

ID/Status: 0613329 / 2007-06-01
ID/Status: 378340
ID/Status: 2007-03-12

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: HARLEM RIVER YARDS SITE

Address: SAINT ANNE'S/ 132ND AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0613329 / 2007-06-01

Facility ID: 0613329

Facility Type: ER

DER Facility ID: 327881

Site ID: 378340

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2007-03-12

Investigator: hrpatel

Referred To: Not reported

Reported to Dept: 2007-03-12

CID: 408

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2007-03-12

Spill Record Last Update: 2007-06-01

Spiller Name: Not reported

Spiller Company: HISTORICAL SPILL

Spiller Address: Not reported

Spiller Company: 999

Contact Name: STEVEN PORTER

DEC Memo: "03/13/07-Hiralkumar Patel. spoke with Mr. Porter at Harlem River yards. as per Mr. Porter, they have lease on this land since 1980.

NYSDOT owns this land. contamination found during construction

activities as FedEx constructing building at site. Mr. Porter asked

FedEx to stop all construction activities unless this contamination

issue addressed properly. as per Mr. Porter this land was used to be

Penn Central Railroad yard in 1960-1970. contamination found at 6-8

ft bg with PID. no samples taken yet to confirm contamination. Mr.

Porter asked to send letter on his name and he will forward letter to

NYSDOT. Steven Porter Senior Vice President & General Counsel Harlem

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S108466658	DIST/DIR: 0.059 SE	ELEVATION: 18	MAP ID: K62

NAME: HARLEM RIVER YARDS SITE

Rev: 08/09/2021

ADDRESS: SAINT ANNE'S/ 132ND AVE
BRONX, NY
BRONX

ID/Status: 0613329 / 2007-06-01
ID/Status: 378340
ID/Status: 2007-03-12

SOURCE: NY Department of Environmental Conservation

River Yards Ventures, Inc. 695 Rotterdam Industrial Park Schenectady, NY 12306 Ph. (518) 356-4445 Ext. 110 Fax (518) 356-5334 email: sporter@galesi.com found another open spill #: 9612518. spoke with Kevin (Fax: 973-338-1052) at Earth Tech. he mentioned that the site is under Brownfield program. 03/19/07-Hiralkumar Patel. spoke with Mr. Porter. he mentioned that this site is not under brownfield program. 03/21/07-Hiralkumar Patel. received call from Carolina Benedict from Earth Tech. she mentioned that this site is not under brownfield program. she also mentioned that they did phase I and some soil/groundwater testing and found nothing in samples. groundwater is about 7 ft bg. asked Ms. Benedict to send copy of phase I report and analytical data for samples taken before. explained her that before any construction, the department requires soil and groundwater investigation. Ms. Benedict mentioned that FedEx is moving his building from manhattan location to harlem river yard. FedEx is moving out because 7 subway expansion requies that area. due to time constraints, FedEx has to move quickly to avoid penalties. so Ms. Benedict wants to start construction meanwhile doing soil/groundwater investigation/excavation. Carolina Benedict PH. (518) 951-2369 (O) (518) 429-1338 Fax (518) 951-2300 email: Caroline.Benedict@earthtech.com spoke with Mr. Porter. he send contact in DOT. Mr. Porter requested permission to keep working on construction project while doing investigation. Bruce Davis NYS DOT, Real Estate POD 4-1 50 Wolf Road Albany, NY 12232 Ph. (518) 457-2761 FAX (518) 457-8069 email: BDAVIS@dot.state.ny.us Tom Perreaulp, Assisting Counsel tperreaulp@dot.state.ny.us Mary Ivey, Director of environmental services mivey@dot.state.ny.us discussed with DEC Austin. he asked to investigate soil via test pits around contaminated area, if owner want to work quickly, and characterize the soil and find any contamination in groundwater. sent letter to Mr. Davis requiring soil/groundwater delineation, soil endpoint samples, vapor barrier and CAMP. letter emailed to Mr. Davis and Mr. Porter. letter faxed to Ms. Benedict. 03/22/07-Hiralkumar Patel. received spill investigation/remedial action work plan from Ms. Benedict. abstract: - contamination found in soil at a depth of approx. 6-7 ft bg in northwest corner of proposed FedEx footprints - PID read 968 ppm and exhibited a strong odor <----- - proposes to install a series of test pits in the vicinity of excavation area - test pits will be installed to a maximum depth of 10 ft below pre-existing grade or top of groundwater table, whichever is shallower - no samples will be collected if no PID readings or odors in test pit - if impacted soil extends into groundwater, then a grab groundwater sample will be collected from that test pit and from test pit downgradient from impacted one - proposed remedial action is excavation of impacted soils down to groundwater table or the

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S108466658 DIST/DIR: 0.059 SE ELEVATION: 18 MAP ID: K62

NAME: HARLEM RIVER YARDS SITE

Rev: 08/09/2021

ADDRESS: SAINT ANNE'S/ 132ND AVE
BRONX, NY
BRONX

ID/Status: 0613329 / 2007-06-01
ID/Status: 378340
ID/Status: 2007-03-12

SOURCE: NY Department of Environmental Conservation

vertical limit of nuisance characteristics, whichever is shallower - air monitoring will be done during excavation - depending on length of sidewalls, a composite sample of upto three locations will be collected for each sidewall and composite sample from upto four locations will be collected for the bottom sample Ms. Benedict has also sent pages from previous phase I and II investigation (not full report). but this doesn't include sample analyticals.
03/23/07-Hiralkumar Patel. received Limited PHase II investigation report, done by Roux Associates in 09/2005, from Ms. Benedict.
abstract: - Phase 1A site assessment was conducted in 1990 by TAMS (Earth Tech). -***** (abstract of phase 1A done by TAMS) - TAMS didn't find any evidence of known or documented contaminated areas of the site, or indications of pervasive or large spread contamination present - did find 15 to 20 potential hot spots throughout the site based on a review of historical documents - main potential hot spot noted in the area of the site of interest to FedEx was two diesel USTs located to the east of Triborough Bridge - in Oct. 1990 TAMS conducted a phase 1B investigation, which consisted of a soil gas survey (total 8 soil gas samples), and the collection of several soil samples (total 30 soil samples) - all soil samples were either surface or near-surface samples, with a maximum depth interval being 30 inches below land surface (bls) <----- - soil gas survey data revealed measurable VOCs in soil gas, centered around the fuel pump island (formerly located near the diesel USTs) - as per Mr. Fiteni from TAMS (earth tech), the two USTs found to the west of the Triborough Bridge were removed, all contaminated soil was excavated and disposed off-site and post-excavation soil samples were collected. <----- no report available - from historical sanborn maps, in 1940, six gasoline USTs and a pump island were built on the northern section of the site <----- in 1968 Sanborn map doesn't show pump island and six gasoline USTs (no information whether tanks removed from site) -***** - Roux did soil investigation. - Roux did 10 soil borings (SB-1 through SB-10). samples were collected continuously from land surface to water table, which ranged from 11 to 15 ft bls - one soil sample was selected from each boring - discrete groundwater samples were collected at borings SB-3, SB-4 and SB-5, from the two feet interval immediately below the water table - soil lithology generally consisted of a black to brown fine to medium sand, with some gravel, slag and brick and wood found in upper 10 ft - some finer sand, silt and organic peat material was found near the water table - PID reading from soil from each boring ranging from 0 to 1 ppm - no contamination found in any groundwater sample - few SVOC compounds found in soil samples. highest SVOC concentration found in sample SB-7 (~ 2000 ppb for

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S108466658 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K62

NAME: HARLEM RIVER YARDS SITE

Rev: 08/09/2021

ADDRESS: SAINT ANNE'S/ 132ND AVE
BRONX, NY
BRONX

ID/Status: 0613329 / 2007-06-01

ID/Status: 378340

ID/Status: 2007-03-12

SOURCE: NY Department of Environmental Conservation

benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene, chrysene etc.) - found mercury concentration above limit in most of soil samples 03/26/07-Hiralkumar Patel. visited site. met Ms. Benedict. as per Ms. Benedict, they removed five diesel USTs in 1997 and are looking for report on tank removal. this diesel UST area is within building footprint, but not gasoline USTs. found piers installed in area where earth tech was planning to excavate test pits. Ms. Benedict will ask contractor to remove piers as needed. dig one test pit and found heavy petroleum odor in soil about one ft above water table. this test pit and original location, where contamination found initially, are DOWNGRADIANT from gasoline UST location. as per Ms. Benedict, they are planning to excavate area which is contaminated, to the water table, instead of spending time in soil testing. discuss with DEC Austin. he asked for CAMP before any soil excavation. spoke with Ms. Benedict. asked her to submit CAMP before any excavation. 03/27/07-Hiralkumar Patel. DEC Austin asked to send STIP. 03/29/07-Hiralkumar Patel. received CAMP from Ms. Benedict. received email from Mr. Porter containing information about building developer: Mr. Robert McClendon Vice President, Project Development McMahon Development Group LLC. 500 Stevens Avenue, Suite 200 Solana Beach, CA 92075 PH. (858) 350-0200 Ext. 211 (O) (619) 994-7800 Fax (858) 350-0220 email: rmccclendon@mdgusa.com Mr. Porter also sent site address specifically for FedEx building location as 670 E 132nd street. discussed STIP with DEC Austin. he asked to send STIP to environmental consultant (Ms. Benedict) and required that building developer (McMahon Development Group, LLC) should sign this STIP (not NYSDOT as currently dealing with part of the land, but not entire site). sent STIP to Ms. Benedict as required by DEC Austin. emailed copy of this STIP to Ms. Benedict, Mr. Porter, Mr. McClendon and Mr. Davis. received call from Ms. Benedict about STIP. spoke with Ms. Benedict with DEC Austin on conference call. Ms. Benedict mentioned that they have taken some soil and groundwater samples from test pit and got analysis back. Ms. Benedict will send sample analyticals. Ms. Benedict is looking for diesel tanks removal report. as per her, they have reported contaminated soil found during diesel tank removal. she will send spill case #. Austin mentioned to Ms. Benedict that if report not found, she has to investigate soil around location of previously removed diesel tanks. Ms. Benedict mentioned that groundwater flows quickly in excavated pit. Austin asked either to discharge this water into city sewer (after permission from NYC DEP) or to store and treat on-site (oil/water separator and/or carbon filtration). DEC Austin also mentioned that as DEC requires STIP, no separate State Pollution Discharge Elimination System (SPDES) permit will be required. Ms. Benedict also mentioned that Earth Tech is working for Harlem River Yard Ventures, not for McMahon developers.

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S108466658	DIST/DIR: 0.059 SE	ELEVATION: 18	MAP ID: K62

NAME: HARLEM RIVER YARDS SITE

Rev: 08/09/2021

ADDRESS: SAINT ANNE'S/ 132ND AVE
BRONX, NY
BRONX

ID/Status: 0613329 / 2007-06-01
ID/Status: 378340
ID/Status: 2007-03-12

SOURCE: NY Department of Environmental Conservation

and she believes that McMahon will not sign the STIP. she will call Mr. Porter and will send information about person/organization who should sign the STIP. DEC Austin asked to send STIP again in referenced to authorized person/organization who will going to sign it. 03/30/07-Hiralkumar Patel. received old spill # 9612518, for contaminated soil found during diesel tank removal. spill reported by TAMS conducting in 1997. TAMS is part of EArth Tech now. DEC Sarah Carlson is working on this case. she spoke with Paul Pastecki (518-485-2991) in NYS DOT regarding closure report. no reports available till date. as this diesel tank location is inside FedEx building footprint, as per DEC Austin it will be investigated under new spill #: 0613329. old spill #: 9612518 has been deactivated. sent email to Sarah explaining the situation and reason for closing old case. received soil and groundwater sample analyticals from Ms. Benedict. they took 6 soil and one groundwater sample. detected VOCs and SVOCs in test pit #2, but only one VOC is above limit. MTBE and Benzene found, little above than limit, in groundwater sample from test pit #8. Ms. Benedict also sent site plan with test pit locations. received email from Ms. Benedict about who should sign STIP. ...Delete reference to the Building Developer. HRYV is the long-term ground lessee. Based on the agreement between the building developer and HRYV, HRYV is responsible for addressing any pre-existing site conditions, such as this release. Ms. Benedict has copied this email to Mr. Porter also. received revised remedial action plan (based on test pit analyticals) and revised CAMP. abstract of remedial action plan: - during test pit investigation, upper 4 to 6 ft of overburden did not exhibit odors/PID readings, while the underlying 3 to 5 ft of material overlying groundwater exhibited odors. - groundwater collecting in the excavation area will be pumped into a large-capacity temporary storage tank, equipped with an oil/water separator - water may be discharged into city sewer (if get permission from NYC DEP) - if water exceeds discharge limit, then it will be treated by passing it thorough carbon filtration - proposed remedial action is intended to avoid the necessity of installing vapor mitigation based on source removal, slab-on-grade building construction, and depth to remediated media, no vapor mitigation or vapor intrusion evaluation is proposed at this time. <----- - as per DER-10 section 6.1 (b) 1.ii: no operation, maintenance and monitoring plan (OMMP) is required for sites where the remediation duration is less than 18 months and limited monitoring will be required. <----- - at this time, no monitoring wells are proposed to evaluate post-remedial groundwater quality <----- 04/02/07-Hiralkumar Patel. discussed with DEC Austin. he requires OMMP regardless of timing of remediation (to prevent any future problems from the site). he also asked to keep

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S108466658	DIST/DIR: 0.059 SE	ELEVATION: 18	MAP ID: K62

NAME: HARLEM RIVER YARDS SITE

Rev: 08/09/2021

ADDRESS: SAINT ANNE'S/ 132ND AVE
BRONX, NY
BRONX

ID/Status: 0613329 / 2007-06-01
ID/Status: 378340
ID/Status: 2007-03-12

SOURCE: NY Department of Environmental Conservation

vapor mitigation requirement in Corrective action plan, but may not be required after contractor done with remediation and based on endpoint sample analyticals. received call from Ms. Benedict. she will send revised remedial action plan (@ groundwater handling). received revised RAP (04/02/07) from Ms. Benedict. Ms. Benedict proposed change in handling groundwater during excavation. as per revised RAP: - since the soil remediation is not proposed to extend into the groundwater table at any appreciable depth, it is anticipated that a limited amount of groundwater will collect in the excavation. - groundwater will be managed within the excavation by creating a collection sump at a low point in elevation - if free product is observed on excavation water, measures will BE TAKEN TO SKIM THE WATER SURFACE WITH ABSORBENT MATERIAL AND IF NECESSARY, PUMP THE AREA OF GROUNDWATER UNTIL THE PRODUCT IS REMOVED AND DISPOSED OF THE MATERIAL APPROPRIATELY discussed this revised RAP with Austin. he is not agree with it and still requires old RAP (submitted on 03/30/07) in effect. his main concern is handling wet soil during excavation. sent email to Ms. Benedict to inform that RAP that was submitted on 03/30/07 will remain in effect. received call from Ms. Benedict. spoke with Ms. Benedict and DEC Austin. Austin explained her that DEC requires plan to handle wet contaminated soil/groundwater encountered during excavation. DEC still requires collection and discharge/treatment of groundwater. Ms. Benedict sent another revised RAP (third revision) after earlier discussion how they will handle groundwater from excavation. now Ms. Benedict proposing collection of groundwater in large tank and disposal lateron. they will remove soil from excavation (cut-and-fill method) and will staged on-site. the staging area will be lined with plastic and bermed to prevent leakage of water from the pile. during trsporting off-site, earth tech will load excavated soil on lined and covered truck. discussed with Austin about vapor mitigation and OMMP requirement. as per proposed RAP, contractor is not planning to install vapor barrier or any OMMP. Austin agreed with this proposed plan now, but he mentioned that DEC may require both based on remedial action report and Austin asked to make corrective action plan with this requirement. sent corrected/revised STIP to Mr. Porter. emailed copy of STIP to Mr. Porter, Ms. Benedict, Mr. Davis and Mr. McClendon. 04/03/07-Hiralkumar Patel. received signed STIP from Mr. Porter. 05/01/07-Hiralkumar Patel. received test pit investigation report. abstract: - based on overlays of the scaled Sanborn Map to site plan, it appears that the gasoline storage tank area is within the current spill area and is likely the source of the petroleum contamination. - 21 test pits were installed, to a maximum depth of 12 ft below existing pre-construction grade, in the area of reported spill - an area approx. 130 ft wide and 170 ft in lenght is

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S108466658	DIST/DIR: 0.059 SE	ELEVATION: 18	MAP ID: K62

NAME: HARLEM RIVER YARDS SITE

Rev: 08/09/2021

ADDRESS: SAINT ANNE'S/ 132ND AVE
BRONX, NY
BRONX

ID/Status: 0613329 / 2007-06-01
ID/Status: 378340
ID/Status: 2007-03-12

SOURCE: NY Department of Environmental Conservation

impacted for an average thickness of five ft, with groundwater generally present at the base of contamination received spill status update. abstract: - no closure report available for diesel USTs removal <----- soils exhibiting nuisance characteristics are being excavated to groundwater table - 21,000 gal fractionation tank is present on-site. to date, approx. 33,000 gal water have been pumped and 20,000 gal have been transported off-site - portions of excavation have been backfilled, confirmatory side wall samples are being collected - community air monitoring for dust and VOCs is ongoing - to date, approx. 1,800 cubic yard of contaminated soil have been excavated sent email to Ms. Benedict requiring soil/groundwater delineation around previously removed diesel UST system area (including tank, dispenser island, fill port and all lines), as payment certification is not enough to prove soil quality. 05/03/07-Hiralkumar Patel. received email from Ms. Benedict. they haven't found any report on diesel UST removal. as per Ms. Benedict pumps, tank and pipings were installed together. they are proposing test pits around previous diesel UST location and will take composite samples. 05/08/07-Hiralkumar Patel. received call from Ms. Benedict about test pits around diesel UST area. DEC Austin is not in office, so asked Ms. Benedict to proceed with test pits around tank location, but no major construction activities until the department receives analytical data and DEC Austin approves it. 05/17/07-Hiralkumar Patel. received analytical data for samples from test pits around previously removed diesel USTs area. no contamination found in soil or groundwater sample. sent email to Ms. Benedict to submit official report with scaled site plan and information on location of tank and dispenser island. 05/30/07-Hiralkumar Patel. received Remedial Action REport and Historical Diesel Area investigation report. abstract of remedial action report: - approx. 2650 cubic yard of gasoline impacted soil was excavated - overburden soil that did not exhibit nuisance characteristics was segregated for use for backfill - total seven post-excavation soil samples were collected from the base of the excavation sidewalls - test pits were installed immediately west of area of shallow bedrock and north of the railroad tracks to evaluate the potential for petroleum impacts. three samples were collected from these locations - no free product was observed during the remedial action - rusted underground steel piping and buried scraps of metal were encountered during the excavation in the central and northern portions of the excavation - an underground vault fabricated out of wood, concrete and brick was encountered in the northeast portion of the remediated area minor VOC contamination found in groundwater sample from middle of excavation (highest value is 170 ppb of m,p-Xylene) abstract of diesel UST area investigation report: - two diesel USTs were removed in Jan. 1997 - in order to

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S108466658 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K62

NAME: HARLEM RIVER YARDS SITE

Rev: 08/09/2021

ADDRESS: SAINT ANNE'S/ 132ND AVE
BRONX, NY
BRONX

ID/Status: 0613329 / 2007-06-01
ID/Status: 378340
ID/Status: 2007-03-12

SOURCE: NY Department of Environmental Conservation

recreate the location of the historical USTs, scaled drawings from historical site investigations were overlaid on the current pile plan for the site - total five test pits were installed in the former UST area to a depth of 12 ft below construction grade (3.5 ft below normal grade) or the water table, whichever was shallower - soil samples were collected at the base of four of the five test pits. a groundwater sample was collected from one test pit - no contamination found in soil or groundwater samples. 06/01/07-Hiralkumar Patel. discussed Remedial action report and diesel UST investigation report with DEC Austin. based on available reports, DEC Austin asked to close the case. sent NFA letter to Mr. Porter. letter emailed to Mr. Davis, Ms. Benedict and Mr. McClendon."

Remarks: "WHILE CONTRACTOR WAS ESACTAVING FOUND HISTORICAL CONTAMINATION; SMELLS LIKE PETROLEUM BUT NOT CONFIRMED; NOT YET CLEANED; NYS DOT OWNS PROPERTY BUT IS LEASED TO HARLEM RIVER YARD VENTURES AND IS THE OPERORATER; CONTRACTOR IS EXPECTED TO BE DOING REMEDATION;"

All Materials:

Site ID: 378340

Operable Unit ID: 1135845

Operable Unit: 01

Material ID: 2125776

Material Code: 0064A

Material Name: unknown material

Case No.: Not reported

Material FA: Other

Quantity: Not reported

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S112148372	DIST/DIR: 0.059 SE	ELEVATION: 18	MAP ID: K63

NAME: HARLEM RIVER POWER PLANT UNIT #1

Rev: 08/09/2021

ADDRESS: 132ND ST/ ST ANN ST
BRONX, NY
BRONX

ID/Status: 1204530 / 2012-08-09
ID/Status: 467418
ID/Status: 2012-07-26

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: HARLEM RIVER POWER PLANT UNIT #1
Address: 132ND ST/ ST ANN ST
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 1204530 / 2012-08-09
Facility ID: 1204530
Facility Type: ER
DER Facility ID: 421730
Site ID: 467418
DEC Region: 2
Spill Cause: Equipment Failure
Spill Class: D5
SWIS: 0301
Spill Date: 2012-07-26
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 2012-08-06
CID: Not reported
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2012-08-06
Spill Record Last Update: 2012-08-09
Spiller Name: WALTER SOTO
Spiller Company: NY POWER AUTHORITY
Spiller Address: 132ND ST/ ST ANN ST
Spiller Company: 999
Contact Name: WALTER SOTO
DEC Memo: "Copy of report forwarded to DEC Air Unit"
Remarks: "Nitrogen Oxide released to Outside Air from a loss of water control,
Thermal emissions. States it was 5.9 Pounds over the allowable limit
Correction, 3.9lbs"

All Materials:
Site ID: 467418
Operable Unit ID: 1217374
Operable Unit: 01
Material ID: 2215645
Material Code: 0243A

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S112148372 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K63

NAME: HARLEM RIVER POWER PLANT UNIT #1

Rev: 08/09/2021

ADDRESS: 132ND ST/ ST ANN ST
BRONX, NY
BRONX

ID/Status: 1204530 / 2012-08-09
ID/Status: 467418
ID/Status: 2012-07-26

SOURCE: NY Department of Environmental Conservation

Material Name: nitrogen dioxide
Case No.: 10544726
Material FA: Hazardous Material
Quantity: Not reported
Units: L
Recovered: Not reported
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S110306917 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K64

NAME: 215294; E 132ND STREET AND ST. ANN'S PLACE

Rev: 08/09/2021

ADDRESS: E 132ND STREET AND ST. ANN'S PLACE
NEW YORK, NY
BRONX

ID/Status: 0913975 / 2009-02-05

ID/Status: 433069

ID/Status: 2009-01-24

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: 215294; E 132ND STREET AND ST. ANN'S PLACE

Address: E 132ND STREET AND ST. ANN'S PLACE

City,State,Zip: NEW YORK, NY

Spill Number/Closed Date: 0913975 / 2009-02-05

Facility ID: 0913975

Facility Type: ER

DER Facility ID: 387080

Site ID: 433069

DEC Region: 2

Spill Cause: Unknown

Spill Class: D4

SWIS: 0301

Spill Date: 2009-01-24

Investigator: DMPOKRZY

Referred To: Not reported

Reported to Dept: 2009-03-30

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: Not reported

Last Inspection: Not reported

Recommended Penalty: Not reported

UST Trust: Not reported

Remediation Phase: 0

Date Entered In Computer: 2010-04-16

Spill Record Last Update: 2010-04-16

Spiller Name: ERT DESK

Spiller Company: CON EDISON

Spiller Address: 5030 BROADWAY

Spiller Company: 001

Contact Name: ERT DESK

DEC Memo: ""

Remarks: ""

All Materials:

Site ID: 433069

Operable Unit ID: 1183980

Operable Unit: 01

Material ID: 2178237

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S110306917 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K64

NAME: 215294; E 132ND STREET AND ST. ANN'S PLACE

Rev: 08/09/2021

ADDRESS: E 132ND STREET AND ST. ANN'S PLACE
NEW YORK, NY
BRONX

ID/Status: 0913975 / 2009-02-05

ID/Status: 433069

ID/Status: 2009-01-24

SOURCE: NY Department of Environmental Conservation

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: Not reported

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019908353	DIST/DIR: 0.059 SE	ELEVATION: 18	MAP ID: K65

NAME: CON EDISON ADDRESS: SAINT ANNS AVE & E 132ND ST BRONX, NY 10454 BRONX SOURCE: US Environmental Protection Agency	Rev: 09/13/2021 ID/Status: NYP004844904

RCRA NonGen / NLR:
 Date Form Received by Agency: 20150928
 Handler Name: CON EDISON
 Handler Address: SAINT ANNS AVE & E 132ND ST
 Handler City,State,Zip: BRONX, NY 10454
 EPA ID: NYP004844904
 Contact Name: THOMAS TEELING
 Contact Address: Not reported
 Contact City,State,Zip: Not reported
 Contact Telephone: 212-460-3770
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Private
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R2
 Mailing Address: IRVING PL 15TH FL NE
 Mailing City,State,Zip: NEW YORK, NY 10003
 Owner Name: Not reported
 Owner Type: Not reported
 Operator Name: Not reported
 Operator Type: Not reported
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019908353 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K65

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS AVE & E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP004844904

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDs Where RCRA CA has Been Imposed Universe: No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSD Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150928
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019908353 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K65

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS AVE & E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP004844904

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150928
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010327334 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K66

NAME: CON EDISON MANHOLE 29292

Rev: 09/13/2021

ADDRESS: E 132 ST & ST ANNS
BRONX, NY 10454
BRONX

ID/Status: NYP004145850

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20070111

Handler Name: CON EDISON MANHOLE 29292

Handler Address: E 132 ST & ST ANNS

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004145850

Contact Name: DANIEL PONTECORVO

Contact Address: 4 IRVING PL, RM 828

Contact City,State,Zip: NEW YORK, NY 10003

Contact Telephone: 212-580-8383

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Not reported

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: 4 IRVING PL, RM 828

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010327334	DIST/DIR: 0.059 SE	ELEVATION: 18	MAP ID: K66

NAME: CON EDISON MANHOLE 29292

Rev: 09/13/2021

ADDRESS: E 132 ST & ST ANNS
BRONX, NY 10454
BRONX

ID/Status: NYP004145850

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20070109
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010327334 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K66

NAME: CON EDISON MANHOLE 29292

Rev: 09/13/2021

ADDRESS: E 132 ST & ST ANNS
BRONX, NY 10454
BRONX

ID/Status: NYP004145850

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Not reported
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070110
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070111
Handler Name: CON EDISON MANHOLE 29292
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010327334 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K66

NAME: CON EDISON MANHOLE 29292

Rev: 09/13/2021

ADDRESS: E 132 ST & ST ANNS
BRONX, NY 10454
BRONX

ID/Status: NYP004145850

SOURCE: US Environmental Protection Agency

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019903738 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K67

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 132ND ST & ST ANNS AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004789269

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150602

Handler Name: CON EDISON

Handler Address: 132ND ST & ST ANNS AVE

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004789269

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019903738 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K67

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 132ND ST & ST ANNS AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004789269

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150602
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019903738 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K67

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 132ND ST & ST ANNS AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004789269

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150602
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019325654 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K68

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS AVE & E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP004844995

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150928

Handler Name: CON EDISON

Handler Address: SAINT ANNS AVE & E 132ND ST

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004844995

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019325654 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K68

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS AVE & E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP004844995

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Biennial: List of Years
Year: 2015

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019325654 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K68

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS AVE & E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP004844995

SOURCE: US Environmental Protection Agency

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code: D008

Waste Description: LEAD

Handler - Owner Operator:

Owner/Operator Indicator: Owner

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20150928

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20150928

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20160226

Handler Name: CON EDISON - MANHOLE 6019

Federal Waste Generator Description: Large Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019325654 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K68

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS AVE & E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP004844995

SOURCE: US Environmental Protection Agency

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150928
Handler Name: CON EDISON
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150928
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 221122
NAICS Description: ELECTRIC POWER DISTRIBUTION

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280291	DIST/DIR: 0.059 SE	ELEVATION: 18	MAP ID: K69

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & SAINT ANNS AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004751632

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150316
 Handler Name: CON EDISON
 Handler Address: E 132ND ST & SAINT ANNS AVE
 Handler City,State,Zip: BRONX, NY 10454
 EPA ID: NYP004751632
 Contact Name: THOMAS TEELING
 Contact Address: Not reported
 Contact City,State,Zip: Not reported
 Contact Telephone: 212-460-3770
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Private
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R2
 Mailing Address: IRVING PL, 15TH FL NE
 Mailing City,State,Zip: NEW YORK, NY 10003
 Owner Name: Not reported
 Owner Type: Not reported
 Operator Name: Not reported
 Operator Type: Not reported
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280291 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K69

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & SAINT ANNS AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004751632

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160502
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Biennial: List of Years
Year: 2015

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280291 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K69

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & SAINT ANNS AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004751632

SOURCE: US Environmental Protection Agency

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code: D008

Waste Description: LEAD

Handler - Owner Operator:

Owner/Operator Indicator: Operator

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20150316

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20150316

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20160205

Handler Name: CON EDISON - MANHOLE 29290

Federal Waste Generator Description: Large Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280291 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K69

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & SAINT ANNS AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004751632

SOURCE: US Environmental Protection Agency

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150316
Handler Name: CON EDISON
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150316
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 221122
NAICS Description: ELECTRIC POWER DISTRIBUTION

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S110611585 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K70

NAME: HARLEM RIVER YARD POWER PLANT

Rev: 08/09/2021

ADDRESS: 132ND AND ST ANNES
BRONX, NY
BRONX

ID/Status: 1007828 / 2010-10-25
ID/Status: 441276
ID/Status: 2010-10-24

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: HARLEM RIVER YARD POWER PLANT

Address: 132ND AND ST ANNES

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 1007828 / 2010-10-25

Facility ID: 1007828

Facility Type: ER

DER Facility ID: 396304

Site ID: 441276

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 2010-10-24

Investigator: SFRAHMAN

Referred To: Not reported

Reported to Dept: 2010-10-24

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2010-10-24

Spill Record Last Update: 2010-10-25

Spiller Name: Not reported

Spiller Company: NAES

Spiller Address: Not reported

Spiller Company: 999

Contact Name: JOE MCWILLIAMS

DEC Memo: "Spoke with Joe McWilliams. Approx 0.5 gallon mineral oil spilled due to a leak of lower seal on pathhead. Spill was cleaned up immediately. Case closed.(sr)"

Remarks: "cleanup pending supervisor to get to site"

All Materials:

Site ID: 441276

Operable Unit ID: 1191842

Operable Unit: 01

Material ID: 2187043

Material Code: 0020A

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S110611585 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K70

NAME: HARLEM RIVER YARD POWER PLANT

Rev: 08/09/2021

ADDRESS: 132ND AND ST ANNES
BRONX, NY
BRONX

ID/Status: 1007828 / 2010-10-25
ID/Status: 441276
ID/Status: 2010-10-24

SOURCE: NY Department of Environmental Conservation

Material Name: transformer oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .03
Units: Not reported
Recovered: Not reported
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106001517	DIST/DIR: 0.059 SE	ELEVATION: 18	MAP ID: K71

NAME: MANHOLE 24738

Rev: 08/09/2021

ADDRESS: E 132 ST & ST ANNES AV
BRONX, NY
BRONX

ID/Status: 0111389 / 2002-04-16

ID/Status: 149639

ID/Status: 2002-03-02

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 24738

Address: E 132 ST & ST ANNES AV

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0111389 / 2002-04-16

Facility ID: 0111389

Facility Type: ER

DER Facility ID: 127261

Site ID: 149639

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 2002-03-02

Investigator: KMFOLEY

Referred To: Not reported

Reported to Dept: 2002-03-02

CID: 365

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2002-03-02

Spill Record Last Update: 2002-04-16

Spiller Name: Not reported

Spiller Company: CON EDISON

Spiller Address: 4 IRVING PLACE

Spiller Company: 001

Contact Name: Not reported

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

FOLEY Con Ed e2mis #141601 Notes: 02-Mar.-2002 @ 11:15 Hrs. Senior

Engineering Tech, Jake Troncone, #24738 was performing Quality

Assurance inspection work and found 6 ounces dielectric fluid leaking

from a dead end cable onto the floor of manhole #5968. No sewers,

waterways or private property affected. No smoke or fire involved.

Employee is unable to obtain sample due to 3-M cable joint 'D' fault

in the structure. Clean up pending follow up by the Underground.

02-Mar.-2002 @ 12:08 Hrs. CIG J. Fox notified. 02-Mar-2002 @ 12:30

Hrs. 'D' Fault confirmed, unsupported 3-M joint on fdr. 3M65 in the

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106001517 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K71

NAME: MANHOLE 24738

Rev: 08/09/2021

ADDRESS: E 132 ST & ST ANNES AV
BRONX, NY
BRONX

ID/Status: 0111389 / 2002-04-16

ID/Status: 149639

ID/Status: 2002-03-02

SOURCE: NY Department of Environmental Conservation

middle of the manhole. Feeder repair needed before clean up on dead end cable can be completed. This will not be able to be cleaned within 24 hours. Environmental tag #20556 installed. 07-March-2002 20:43 Hrs. Feeder Controller Emanuel Bylick, #40075, reports feeder with default is 3M43 which is scheduled to be deloaded on March 12th for work on March 13th. 11-Mar-2002 @ 07:00 Hrs Report received from feeder Control representative V.Headley, MH 5968, Fdr 3m43 has been identified as DEAD CABLE . Field Operators have tagged 3m snap joint as DEAD. Flush Supervisor C. D'Alisera will take sample and clean up will be scheduled when results are received. 16-MAR-2002 06:28 D-Fault feeder identified as Dead Fdr 3M72. FOD to locate cables ends week of 3/18/02 per FCR C. McGuire 68963. 16-Mar-2002 20:30 Requested next available > 50 ppm PCB tanker from Astoria Tanker scheduled for 03:00 on 3/17/02. Cleanup will be conducted as a 50 -499 ppm. PCB cleanup. ERT B.Pierre # 85932 issued an EPA # NYP004-096814 16-March-2002 21:15 Feeder Control Rep D. Palmer # 55016 reports D-Fault in mh. 5968 identified via tracing current as dead Fdr. 3 M72. Red Wagons cut and removed same. Ends sealed. 17-MAR-2002 16:41 Lab Sequence Number: 02-02232-001 TEST DESCRIPTION RESULT UNIT METHOD

Aroclor 1242 < 1.0 ppm EPA 608/8082 Aroclor 1254 57.3 ppm EPA 608/8082 Aroclor 1248 14.2 ppm EPA 608/8082 Aroclor 1260 < 1.0 ppm EPA 608/8082

TOTAL PCB 72 ppm 17-MAR-2002 @ 17:55 Hrs Earlier today at 11:00 hrs this report was received by Environmental Supervisor W. Hedeman, Flush mechanic N. McAllister reported that flush crew double washed and cleaned MH, performing cleanup 50-499 PPM. However,they could not finish job and closed incomplete due to emergency job in Westchester that required immediate attention. Job will be followed up on the 3-11 Shift. 17-MAR-2002 @ 18:00 Hrs Flush crew on location M. Derasmo and also Central Transportation Tanker. 17-MAR-2002 @ 22:40 Hrs Report received from Flush mechanic M. Derasmo, flush crew double washed, soaped and cleaned manhole, tanker removed 100 gallons of oil/water mixture. Environmental tag # 20556 was removed. Clean up was performed 50-499 PPM ,generated 2 - 55 gallons that will be manifested under NYP 004 096 814. Clean up completed at at 22:35 Hrs. Transportation will pick up drums with 23:00 Hrs driver. Flush crew on location until drums have been picked up. 18-Mar-2002 @ 01:45 Hrs Transportation picked up 2 -55 gallon drums at 23:45 hrs on 3/17/02. " Not reported

Remarks: "6 OUNCES OF OIL - FROM AN OPEN ENDED CABLE - REF #141601"

All Materials:
Site ID: 149639

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106001517 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K71

NAME: MANHOLE 24738

Rev: 08/09/2021

ADDRESS: E 132 ST & ST ANNES AV
BRONX, NY
BRONX

ID/Status: 0111389 / 2002-04-16

ID/Status: 149639

ID/Status: 2002-03-02

SOURCE: NY Department of Environmental Conservation

Operable Unit ID: 848459
Operable Unit: 01
Material ID: 525417
Material Code: 0541A
Material Name: dielectric fluid
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280877 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K72

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & SAINT ANNS AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004757860

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150325

Handler Name: CON EDISON

Handler Address: E 132ND ST & SAINT ANNS ST

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004757860

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL, 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280877 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K72

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & SAINT ANNS AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004757860

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160502
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150325
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280877 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K72

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & SAINT ANNS AVE
BRONX, NY 10454
BRONX

ID/Status: NYP004757860

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150325
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S118707332 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K73

NAME: POWER PLANT

Rev: 08/09/2021

ADDRESS: EAST 132 AND ST. ANN'S
BRONX, NY
BRONX

ID/Status: 1604543 / 2016-08-08
ID/Status: 531054
ID/Status: 2016-07-31

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: POWER PLANT

Address: EAST 132 AND ST. ANN'S

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 1604543 / 2016-08-08

Facility ID: 1604543

Facility Type: ER

DER Facility ID: 485118

Site ID: 531054

DEC Region: 2

Spill Cause: Human Error

Spill Class: Not reported

SWIS: 0301

Spill Date: 2016-07-31

Investigator: HRAHMED

Referred To: Not reported

Reported to Dept: 2016-08-04

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2016-08-04

Spill Record Last Update: 2016-08-08

Spiller Name: WALTER SATO

Spiller Company: NY POWER AUTHORITY

Spiller Address: EAST 132 AND ST. ANN'S

Spiller Company: 999

Contact Name: WALTER SATO

DEC Memo: "08/08/16- Ahmed - Non-petroleum (nitrogen dioxide) spill, corrective
action taken. Spill closed."

Remarks: "Plant was shut down."

All Materials:

Site ID: 531054

Operable Unit ID: 1279839

Operable Unit: 01

Material ID: 2284929

Material Code: 2692A

Material Name: nitrogen dioxide

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S118707332 **DIST/DIR:** 0.059 SE **ELEVATION:** 18 **MAP ID:** K73

NAME: POWER PLANT

Rev: 08/09/2021

ADDRESS: EAST 132 AND ST. ANN'S
BRONX, NY
BRONX

ID/Status: 1604543 / 2016-08-08
ID/Status: 531054
ID/Status: 2016-07-31

SOURCE: NY Department of Environmental Conservation

Case No.: 10102440
Material FA: Hazardous Material
Quantity: 2.90
Units: L
Recovered: Not reported
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106015861 **DIST/DIR:** 0.061 WSW **ELEVATION:** 16 **MAP ID:** L74

NAME: MANHOLE #23756

Rev: 08/09/2021

ADDRESS: 132ND ST (KILLS RR PROP)
BRONX, NY
BRONX

ID/Status: 0303706 / 2003-08-27

ID/Status: 321432

ID/Status: 2003-07-08

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE #23756

Address: 132ND ST (KILLS RR PROP)

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0303706 / 2003-08-27

Facility ID: 0303706

Facility Type: ER

DER Facility ID: 258936

Site ID: 321432

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2003-07-08

Investigator: AERODRIG

Referred To: Not reported

Reported to Dept: 2003-07-08

CID: 252

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2003-07-08

Spill Record Last Update: 2003-08-28

Spiller Name: UNKNOWN

Spiller Company: Unknown

Spiller Address: UNKNOWN

Spiller Company: 999

Contact Name: PAUL DIDONATO

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was RODRIGUEZ E2MIS 149140 08-July-2003 09:29 Mech A. P.Sepulveda 18502 reports while on location for an inspection discovered 1 quart of unknown oil on 1000 gallons of water. No smoke or fire is/was involved. No sewers, waterways, or private property affected. A pcb and oil id sample was taken on BB08860. Env tag 33804 is placed and there is sure access. 08-July-2003 22:15 Hrs Flush Mechanic Al Guarino, 32988, reported at approximately 21:00 Hrs. today that unsafe conditions prohibit them from entering the manhole to perform a complete cleanup. Underground Operating Supervisor Joe McMahon,

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106015861 **DIST/DIR:** 0.061 WSW **ELEVATION:** 16 **MAP ID:** L74

NAME: MANHOLE #23756

Rev: 08/09/2021

ADDRESS: 132ND ST (KILLS RR PROP)
BRONX, NY
BRONX

ID/Status: 0303706 / 2003-08-27

ID/Status: 321432

ID/Status: 2003-07-08

SOURCE: NY Department of Environmental Conservation

14620, was dispatched to the location and confirmed the manhole casing had shifted and the chimney partially collapsed making the structure unsafe to enter. Cleanup has been suspended pending making the manhole safe to enter and clean. Spill being changed from 24 hr underground deminimis to reportable because repairs will not be made within the 24 hour period from when the spill was first discovered. Aroclor 1242 < 1.0 ppm EPA 608/8082 Aroclor 1254 38.9 ppm EPA 608/8082 Aroclor 1248 < 1.0 ppm EPA 608/8082 Aroclor 1260 < 1.0 ppm EPA 608/8082 Analysis indicates the presence of a substance similar to a lubricating oil. 9-Jul-2003 15:00 hrs EH&S will have Op supv Joe McMahon (14620) check location to ensure casting is safe for entry. 11-Jul-2003 13:00 hrs Flush Mech Esham Gafur (19528) double washed & cleaned structure with Bio-gen 760. CFS tanker removed 2900 gallons of liquid. There were no solids to be removed. Environmental tag #33804 was removed. No visible sign of oil migration into the manhole. Clean up is complete. "

Remarks: "MANHOLE CASING SHIFTED AND CHIMNEY PARTIALLY COLLAPSED MAKING ENTRY UNSAFE. CLEANUP HAS BEEN SUSPENDED TIL REPAIRS ARE MADE. CON ED #149140"

All Materials:

Site ID: 321432

Operable Unit ID: 871736

Operable Unit: 01

Material ID: 562835

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106470872 **DIST/DIR:** 0.061 WSW **ELEVATION:** 16 **MAP ID:** L75

NAME: MANHOLE # 23756

Rev: 08/09/2021

ADDRESS: EAST 132 ND STREET WESTSI
BRONX, NY
BRONX

ID/Status: 0403789 / 2004-12-30

ID/Status: 220052

ID/Status: 2004-07-09

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE # 23756

Address: EAST 132 ND STREET WESTSI

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0403789 / 2004-12-30

Facility ID: 0403789

Facility Type: ER

DER Facility ID: 182004

Site ID: 220052

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2004-07-09

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 2004-07-09

CID: 444

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2004-07-09

Spill Record Last Update: 2004-12-30

Spiller Name: ERT DESK

Spiller Company: Con Ed

Spiller Address: Not reported

Spiller Company: 001

Contact Name: ERT DESK

DEC Memo: "e2mis no. 154272: 1 quart of oil and 200 gallons of water contained in the structure. Cleanup pending test results and equipment de-energization due to d-fault found in the structure. Lab Sequence Number: 04-05373-001 - TOTAL PCB 3 ppm 19-Oct-2004 13:30 hrs Flush Mechanic Ed Cedeno (03384) reports CFS tanker removed 2000 gallons of liquid from structure. There were no solids to be removed. Manhole was double washed with Bio-Gen 760 detergent. The source of the spill was uncapped and abandoned 3c800 PILC cable which has been removed. Environmental tag # 37171 has been removed from the structure. Clean up is complete."

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106470872 **DIST/DIR:** 0.061 WSW **ELEVATION:** 16 **MAP ID:** L75

NAME: MANHOLE # 23756

Rev: 08/09/2021

ADDRESS: EAST 132 ND STREET WESTSI
BRONX, NY
BRONX

ID/Status: 0403789 / 2004-12-30

ID/Status: 220052

ID/Status: 2004-07-09

SOURCE: NY Department of Environmental Conservation

Remarks: "1 QUART UNKNOWN OIL ON 200 GALLONS OF WATER: COBNED# 154272: NO TO 5
QUESTIONS CLEAN UP PENDING TEST RESULTS: "

All Materials:

Site ID: 220052

Operable Unit ID: 887045

Operable Unit: 01

Material ID: 491349

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: Not reported

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103570257 **DIST/DIR:** 0.061 WSW **ELEVATION:** 16 **MAP ID:** L76

NAME: NYS DOT PROPERTY
ADDRESS: OLD HARLEM RIVER RR YARD
BRONX, NY
BRONX

Rev: 08/09/2021
ID/Status: 9612518 / 2007-03-30
ID/Status: 202755
ID/Status: 1997-01-21

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: NYS DOT PROPERTY
Address: OLD HARLEM RIVER RR YARD
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 9612518 / 2007-03-30
Facility ID: 9612518
Facility Type: ER
DER Facility ID: 168651
Site ID: 202755
DEC Region: 2
Spill Cause: Other
Spill Class: B3
SWIS: 0301
Spill Date: 1997-01-21
Investigator: hrpatel
Referred To: TANK CLOSURE REPORT OVERD
Reported to Dept: 1997-01-21
CID: 205
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1997-01-21
Spill Record Last Update: 2007-05-30
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller Company: 999
Contact Name: PAUL TASTECKI
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was K
FOLEY 04/12/04 TRANSFERRED FROM TIPPLE TO SUN. 1/9/06: Case
transferred to Andersen. Tried to call Ted Yen of TANKS consultants
to follow up on a Tank Closure Report. The phone number is now
disconnected. I google searched TAMS consultants and it is apparently
now EarthTech. I called Ted Yen and left a message. EarthTech contact
info: Ted Yen One World Financial Center 200 Liberty Street 25th
Floor New York, NY 10281 Phone: 212-798-8500 Fax: 212-798-8501
1/11/06: Spoke with Joe Seteni. Ted Yen no longer works for the
company. Joe Seteni said he would check the archives and get back to

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103570257 **DIST/DIR:** 0.061 WSW **ELEVATION:** 16 **MAP ID:** L76

NAME: NYS DOT PROPERTY
ADDRESS: OLD HARLEM RIVER RR YARD
BRONX, NY
BRONX

Rev: 08/09/2021
ID/Status: 9612518 / 2007-03-30
ID/Status: 202755
ID/Status: 1997-01-21

SOURCE: NY Department of Environmental Conservation

me. 1/30/06: Left Joe Seteni a message, requesting follow up info.
4/21/06: Left a voice message with Paul Tasteski of NYSDOT. 4/25/06:
Received call from Paul Tastecki. He will look for tank closure
report. 5/23/06: Left phone message with Paul Tastecki to follow up.
8/11/06: Left voice message on answering machine for 518-457-5521.
Property shark does not have a mailing address for this property.
10/25/06: DOT office is on floor 8 and 9 of Hunters Point Plaza.
Could not find a Paul Tastecki. Submitted letter to DOT claims
representative in room 327 of Hunters Point Plaza. 10/27/06: Paul
Pastecki has a new phone number: 518-485-2991. Letter was forwarded to
him from NYSDOT upstairs. 11/6/06: Spoke to Paul Pastecki, he will
forward documents. 12/11/06: Left Paul Pastecki a voice message to
followup on status of document submittal. 3/5/07: Left Joe Fiteni of
Earth Tech a voice message (212-798-8500). 03/30/07-Hiralkumar Patel.
working on another spill case reported after findings of contaminated
soil at site. currently FedEx is constructing building at site which
covers area of previous diesel tank and new contaminated spot found.
so this case is closed and diesel tank area contamination will be
investigated under new spill case. 05/30/07-Hiralkumar Patel.
received diesel UST closure report. consultant did test pit
investigation at former UST location. for closure report, refer spill
#: 0613329."

Remarks: "CALLER STATED WHILE TAKING OUT TWO OLD ABANDONED TANKS, CONTAMINATED
SOIL WAS FOUND."

All Materials:
Site ID: 202755
Operable Unit ID: 1040355
Operable Unit: 01
Material ID: 341162
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103575305	DIST/DIR: 0.061 WSW	ELEVATION: 16	MAP ID: L77

NAME: MANHOLE #23756

Rev: 08/09/2021

ADDRESS: BRONX KILLS RAILRD YARD
BRONX, NY
BRONX

ID/Status: 9811395 / 2001-01-19

ID/Status: 179064

ID/Status: 1998-12-10

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE #23756

Address: BRONX KILLS RAILRD YARD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9811395 / 2001-01-19

Facility ID: 9811395

Facility Type: ER

DER Facility ID: 150306

Site ID: 179064

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 1998-12-10

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 1998-12-10

CID: 252

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1998-12-10

Spill Record Last Update: 2001-12-27

Spiller Name: UNKNOWN

Spiller Company: Unknown

Spiller Address: UNKNOWN

Spiller Company: 999

Contact Name: BILL MURPHY

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL e2mis notes: In MH23756 found approx. 2 qts oil in approx.

50 gal water. No sewer connection in that area. Assuming 50-499 ppm

PCB for clean up. 12/10/98: Clean up completed at 1530 hrs. (JHO,

12/27/01)"

Remarks: "MATERIAL IS CONTAINED IN THE MANHOLE AND WILL BE CLEANED UP LATER

TODAY.CON ED SPILL #121852 "

All Materials:

Site ID: 179064

Operable Unit ID: 1072265

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103575305 **DIST/DIR:** 0.061 WSW **ELEVATION:** 16 **MAP ID:** L77

NAME: MANHOLE #23756

Rev: 08/09/2021

ADDRESS: BRONX KILLS RAILRD YARD
BRONX, NY
BRONX

ID/Status: 9811395 / 2001-01-19
ID/Status: 179064
ID/Status: 1998-12-10

SOURCE: NY Department of Environmental Conservation

Operable Unit: 01
Material ID: 311692
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103483463 **DIST/DIR:** 0.061 WSW **ELEVATION:** 16 **MAP ID:** L78

NAME: MANHOLE 23756

Rev: 08/09/2021

ADDRESS: E 132ND ST
BRONX, NY
BRONX

ID/Status: 8912494 / 2003-02-26

ID/Status: 0409552 / 2005-05-18

ID/Status: 123054

ID/Status: 334391

ID/Status: 1989-12-29

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: HELL GATE SUBSTATION

Address: E 132ND ST

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 8912494 / 2003-02-26

Facility ID: 8912494

Facility Type: ER

DER Facility ID: 106668

Site ID: 123054

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: B3

SWIS: 0301

Spill Date: 1989-12-29

Investigator: CAENGELH

Referred To: Not reported

Reported to Dept: 1995-05-04

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: Not reported

Spill Record Last Update: 2003-02-26

Spiller Name: Not reported

Spiller Company: CON ED

Spiller Address: Not reported

Spiller Company: 999

Contact Name: Not reported

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

ENGELHARDT 2/26/03: Duplicate of spill # 8909451. Close out. (JHO)"

Remarks: "Reported by Con Ed as required under Consent Order."

All Materials:

Site ID: 123054

Operable Unit ID: 938184

Operable Unit: 01

Material ID: 438419

Material Code: 0541A

Material Name: dielectric fluid

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103483463 **DIST/DIR:** 0.061 WSW **ELEVATION:** 16 **MAP ID:** L78

NAME: MANHOLE 23756

Rev: 08/09/2021

ADDRESS: E 132ND ST
BRONX, NY
BRONX

ID/Status: 8912494 / 2003-02-26

ID/Status: 0409552 / 2005-05-18

ID/Status: 123054

ID/Status: 334391

ID/Status: 1989-12-29

SOURCE: NY Department of Environmental Conservation

Case No.: Not reported
Material FA: Petroleum
Quantity: 3700.00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: MANHOLE 23756
Address: E 132ND ST
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 0409552 / 2005-05-18
Facility ID: 0409552
Facility Type: ER
DER Facility ID: 106668
Site ID: 334391
DEC Region: 2
Spill Cause: Equipment Failure
Spill Class: C4
SWIS: 0301
Spill Date: 2004-11-24
Investigator: SKARAKHA
Referred To: Not reported
Reported to Dept: 2004-11-25
CID: 41
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2004-11-30
Spill Record Last Update: 2005-05-18
Spiller Name: Not reported
Spiller Company: CON ED
Spiller Address: Not reported
Spiller Company: 999
Contact Name: ERT DESK
DEC Memo: "e2mis 156370 24-November-2004 21:27 Hrs FOD Operating Supervisor
John Brengal, 88241, reports finding 1 quart of an unknown oil and
2000 gallons of water contained in manhole 23756 on railroad property
beneath the railroad tressel from the Bronx to Randals Island in the

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103483463 **DIST/DIR:** 0.061 WSW **ELEVATION:** 16 **MAP ID:** L78

NAME: MANHOLE 23756

Rev: 08/09/2021

ADDRESS: E 132ND ST
BRONX, NY
BRONX

ID/Status: 8912494 / 2003-02-26

ID/Status: 0409552 / 2005-05-18

ID/Status: 123054

ID/Status: 334391

ID/Status: 1989-12-29

SOURCE: NY Department of Environmental Conservation

Bronx. No fire or smoke is/was involved. No sewers, waterways, or private properties affected. Sample taken for PCB and Oil ID analysis, Cleanup pending test results. Cleanup planned for 7-3 (thanksgiving day) shift. Lab Sequence Number: 04-09794-001: TOTAL PCB 12 ppm 25-Nov-2004 17:00 hrs There is a blown 3w1w lead joint in the manhole. 26-Nov-2004 12:18 hrs Flush Mechanic Tom Brown reports CFS tanker removed 1500 gallons of liquid from manhole. Vactor truck removed 300 lbs of lead hazardous solid debris. Structure was double washed with Bio-Gen 760 detergent. All waste water was removed by the CFS tanker. The defective 3w1w PILC joint has been speared and cut out by UG splicers. Environmental tag # 25896 has been removed. Cleanup is complete."

Remarks: "1 qt on 2000 water in manhole - location is on rr property beneath rr tressle - contained - no to 5 questions - ref 156370 - pending cleanup - coming off 24 hour clock"

All Materials:

Site ID: 334391

Operable Unit ID: 1096525

Operable Unit: 01

Material ID: 576398

Material Code: 0541A

Material Name: dielectric fluid

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018278759	DIST/DIR: 0.065 East	ELEVATION: 18	MAP ID: I79

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & SAINT ANNS PL
BRONX, NY 10454
BRONX

ID/Status: NYP004735403

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150222

Handler Name: CON EDISON

Handler Address: BRUCKNER BLVD & SAINT ANNS PL

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004735403

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL, 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018278759	DIST/DIR: 0.065 East	ELEVATION: 18	MAP ID: I79

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & SAINT ANNS PL
BRONX, NY 10454
BRONX

ID/Status: NYP004735403

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160502
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150222
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018278759 **DIST/DIR:** 0.065 East **ELEVATION:** 18 **MAP ID:** I79

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & SAINT ANNS PL
BRONX, NY 10454
BRONX

ID/Status: NYP004735403

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150222
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: U000410883 **DIST/DIR:** 0.065 WNW **ELEVATION:** 20 **MAP ID:** H80

NAME: BRONX EAST SIDE PARCEL POST ANNEX

Rev: 08/09/2021

ADDRESS: 500 EAST 132ND STREET
BRONX, NY 10454
BRONX

ID/Status: 0302987 / 2006-09-14
ID/Status: 294156
ID/Status: 2003-06-20

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: BRONX EAST SIDE PARCEL POST ANNEX

Address: 500 EAST 132ND STREET

City,State,Zip: BRONX, NY 10454-4619

Spill Number/Closed Date: 0302987 / 2006-09-14

Facility ID: 0302987

Facility Type: ER

DER Facility ID: 21015

Site ID: 294156

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2003-06-20

Investigator: rmpiper

Referred To: Not reported

Reported to Dept: 2003-06-20

CID: 322

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2003-06-20

Spill Record Last Update: 2006-09-14

Spiller Name: NICK DECARLO

Spiller Company: Not reported

Spiller Address: 500 E. 132ND ST

Spiller Company: 001

Contact Name: NICK DECARLO

DEC Memo: "Sent Contaminated Soil Letter 6/30/03 TJD Demeo spoke with Sean

McGonigal of Lois Berger Associates regarding site. Sean states a

closure report is in the mail which describes the activities at site

to date. Reported is a minor Naphthalene exceedance and some PAH

exceedances which Louis Berger is attributing to historical fill in

the area. 11/17/03 SPOKE WITH SEAN, WORK IS PROCEEDING/ REPORT

SCHEDULED TO ARRIVE LATE DECEMBER. Closure report reviewed,

investigation incomplete. Letter sent to USPS requiring additional

investigation and RAP. 7/14/04 tipple updating// very low level

exceedances below 18 of epoxy or similar coating sealed warehouse

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: U000410883	DIST/DIR: 0.065 WNW	ELEVATION: 20	MAP ID: H80

NAME: BRONX EAST SIDE PARCEL POST ANNEX

Rev: 08/09/2021

ADDRESS: 500 EAST 132ND STREET
BRONX, NY 10454
BRONX

ID/Status: 0302987 / 2006-09-14
ID/Status: 294156
ID/Status: 2003-06-20

SOURCE: NY Department of Environmental Conservation

space///Report to follow 9/20/04 TJD The Louis Berger Group submitted a Site investigation report, dated August 4th. Several data discrepancies were identified during report review and the project manager was contacted and directed to revise the report and resubmit. Specific problems include an inaccurate summary table that does not accurately reflect TAGM exceedances, and field observations/instrument measurements do not coincide with laboratory analysis. 1/25/04 TJD Revised subsurface report submitted by the Louis Berger Group. Additional soil/groundwater sampling was performed, revealing low level TAGM exceedances for both soils and groundwater. Due to site constraints USPS and its consultant have repeatedly requested to leave contamination in place with a concrete cap, with no planned remedial action until the facility either undergoes demolition or a major reconstruction. As a precautionary measure the USPS has proposed a deed restriction for the property, which requires a Health & Safety plan and remedial work plan prior to disturbing any subsurface soils. Due to access constraints and nature and extent of the contamination identified through sampling the deed restriction would be acceptable to protect public health. USPS and The Berger Group sent letter notifying them of NYSDEC approval regarding the requested deed restriction. Spill to remain open until copy of deed restriction has been received. SITE DOES NOT MEET STANDARDS All of the contamination is beneath the building - an active postal facility. Following a discussion with RSE (Austin) and Phil Lodico (Central Office - Legal) it has been determined that a deed restriction is not currently a viable option as DEC does not have the mechanisms in place to implement this proposed institutional control. As such USPS was notified via letter that the TAGM exceedances identified through sampling warrant remediation and a remedial work plan is required. (MacCabe) 04/17/06 This site requires active NYSDEC management. The consultant, the Louis Berger Group (610-363-5391) has been conducting site investigation activities. The file has been returned to Region 2. (MacCabe) 9/12/06 - Austin - Spill transferred back down to Region 2 - received remedial investigation report, dated August, 2006, from Louis Berger Group. Spill reassigned to Piper for review of this document - end 9/14/06- DEC Piper reviewed Investigation Report. As per report initial tank closure revealed slight exceedance in soil and gw. GW cont was 1.2 ppb of Pyrene. Additional investigation included 18 soil borings were performed as well as 7 temporary well points. OF the 18 borings, 2 borings had slight VOC exceedances and SVOC were attributed to urban fill. GW samples did not reveal dissolved phase contaminants above TAGM. MW were gauged for three months and recorded no floating product. Based on the data provided. NFA is granted at this time."

Remarks: "bronx - eastside parcel post annex - soil samples taken and they

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: U000410883 **DIST/DIR:** 0.065 WNW **ELEVATION:** 20 **MAP ID:** H80

NAME: BRONX EAST SIDE PARCEL POST ANNEX

Rev: 08/09/2021

ADDRESS: 500 EAST 132ND STREET
BRONX, NY 10454
BRONX

ID/Status: 0302987 / 2006-09-14
ID/Status: 294156
ID/Status: 2003-06-20

SOURCE: NY Department of Environmental Conservation

indicated contamination - napthalene was elevated pbs # 2-476048"

All Materials:

Site ID: 294156

Operable Unit ID: 870723

Operable Unit: 01

Material ID: 507431

Material Code: 0001A

Material Name: #2 fuel oil

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000410883 **DIST/DIR:** 0.065 WNW **ELEVATION:** 20 **MAP ID:** H80

NAME: BRONX EAST SIDE PARCEL POST ANNEX **Rev:** 06/21/2021
ADDRESS: 500 EAST 132ND STREET
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

UST:

Name: BRONX EAST SIDE PARCEL POST ANNEX
Address: 500 EAST 132ND STREET
City,State,Zip: BRONX, NY 10454-4619
Id/Status: 2-476048 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: N/A
UTM X: 590872.18383
UTM Y: 4517576.64652
Site Type: Other

Affiliation Records:

Site Id: 21057
Affiliation Type: Facility Owner
Company Name: UNITED STATES POSTAL SERVICE
Contact Type: Not reported
Contact Name: Not reported
Address1: 558 GRAND CONCOURSE, RM. 318
Address2: Not reported
City: BRONX
State: NY
Zip Code: 10451-9998
Country Code: 001
Phone: (212) 330-3107
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 21057

Affiliation Type: Mail Contact
Company Name: UNITED STATES POSTAL SERVICE
Contact Type: Not reported
Contact Name: NICHOLAS DECARLO
Address1: JAMES A FARLEY BUILDING
Address2: 421 EIGHTH AVENUE, ROOM 5013
City: NEW YORK
State: NY
Zip Code: 10199-9800
Country Code: 001
Phone: (212) 330-3107
EMail: Not reported
Fax Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000410883 **DIST/DIR:** 0.065 WNW **ELEVATION:** 20 **MAP ID:** H80

NAME: BRONX EAST SIDE PARCEL POST ANNEX **Rev:** 06/21/2021
ADDRESS: 500 EAST 132ND STREET
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 21057
Affiliation Type: Facility Operator
Company Name: BRONX EAST SIDE PARCEL POST ANNEX
Contact Type: Not reported
Contact Name: MARLON WILLIAMS
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 402-7443
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 21057
Affiliation Type: Emergency Contact
Company Name: UNITED STATES POSTAL SERVICE
Contact Type: Not reported
Contact Name: NICHOLAS DECRLO
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (917) 370-1648
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 001
Tank ID: 37911
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 10000

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000410883 **DIST/DIR:** 0.065 WNW **ELEVATION:** 20 **MAP ID:** H80

NAME: BRONX EAST SIDE PARCEL POST ANNEX **Rev:** 06/21/2021
ADDRESS: 500 EAST 132ND STREET
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Install Date: 12/01/1968
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 09
Date Test: 08/01/1989
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1004756119 **DIST/DIR:** 0.065 WNW **ELEVATION:** 20 **MAP ID:** H81

NAME: USPS - BRONX VMF & ADMIN OFFICE

Rev: 09/13/2021

ADDRESS: 500 E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NY2180010454

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20071009

Handler Name: USPS - BRONX VMF & ADMIN OFFICE

Handler Address: 500 E 132ND ST

Handler City,State,Zip: BRONX, NY 10454-9703

EPA ID: NY2180010454

Contact Name: DAVID CONOVER

Contact Address: E 132ND ST

Contact City,State,Zip: BRONX, NY 10454-9703

Contact Telephone: 718-742-9876

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Federal

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: E 132ND ST

Mailing City,State,Zip: BRONX, NY 10454-9703

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1004756119 **DIST/DIR:** 0.065 WNW **ELEVATION:** 20 **MAP ID:** H81

NAME: USPS - BRONX VMF & ADMIN OFFICE

Rev: 09/13/2021

ADDRESS: 500 E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NY2180010454

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: The land is federally-owned
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Hazardous Waste Summary:
Waste Code: D001
Waste Description: IGNITABLE WASTE

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1004756119 **DIST/DIR:** 0.065 WNW **ELEVATION:** 20 **MAP ID:** H81

NAME: USPS - BRONX VMF & ADMIN OFFICE

Rev: 09/13/2021

ADDRESS: 500 E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NY2180010454

SOURCE: US Environmental Protection Agency

Waste Code: D002

Waste Description: CORROSIVE WASTE

Waste Code: D008

Waste Description: LEAD

Waste Code: D018

Waste Description: BENZENE

Waste Code: D039

Waste Description: TETRACHLOROETHYLENE

Handler - Owner Operator:

Owner/Operator Indicator: Owner

Owner/Operator Name: UNITED STATES POSTAL SERVICE

Legal Status: Federal

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: 500 E 132ND ST

Owner/Operator City,State,Zip: BRONX, NY 10454-9703

Owner/Operator Telephone: 718-742-9876

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: US POSTAL SERVICE

Legal Status: Federal

Date Became Current: 19801231

Date Ended Current: Not reported

Owner/Operator Address: 500 E 132ND ST

Owner/Operator City,State,Zip: BRONX, NY 10454-9703

Owner/Operator Telephone: 718-742-9876

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: US POSTAL SERVICE

Legal Status: Federal

Date Became Current: 19801231

Date Ended Current: Not reported

Owner/Operator Address: 500 E 132ND ST

Owner/Operator City,State,Zip: BRONX, NY 10454-9703

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1004756119 **DIST/DIR:** 0.065 WNW **ELEVATION:** 20 **MAP ID:** H81

NAME: USPS - BRONX VMF & ADMIN OFFICE

Rev: 09/13/2021

ADDRESS: 500 E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NY2180010454

SOURCE: US Environmental Protection Agency

Owner/Operator Telephone: 718-742-9876
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20060101
Handler Name: USPS - BRONX VMF & ADMIN OFFICE
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20071010
Handler Name: USPS - BRONX VMF & ADMIN OFFICE
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20071009
Handler Name: USPS - BRONX VMF & ADMIN OFFICE
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1004756119 **DIST/DIR:** 0.065 WNW **ELEVATION:** 20 **MAP ID:** H81

NAME: USPS - BRONX VMF & ADMIN OFFICE **Rev:** 09/13/2021
ADDRESS: 500 E 132ND ST **ID/Status:** NY2180010454
BRONX, NY 10454
BRONX
SOURCE: US Environmental Protection Agency

Receive Date: 20000629
Handler Name: US POSTAL SERVICE - BRONX VEHICLE MAINT
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20030730
Handler Name: USPS - BRONX VMF & ADMIN OFFICE
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 49111
NAICS Description: POSTAL SERVICE

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104789615 **DIST/DIR:** 0.065 East **ELEVATION:** 18 **MAP ID:** I82

NAME: MANHOLE 3007

Rev: 08/09/2021

ADDRESS: BRUCKNER BL/ST ANNES AV
BRONX, NY
BRONX

ID/Status: 0007117 / 2000-10-27

ID/Status: 284375

ID/Status: 2000-09-16

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 3007

Address: BRUCKNER BL/ST ANNES AV

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0007117 / 2000-10-27

Facility ID: 0007117

Facility Type: ER

DER Facility ID: 230603

Site ID: 284375

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2000-09-16

Investigator: KMFOLEY

Referred To: Not reported

Reported to Dept: 2000-09-16

CID: 211

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2000-09-16

Spill Record Last Update: 2001-11-27

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: CHARLIE MCCARTHY

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

FOLEY Con Ed e2mis #133435 Notes: 9-16-00 1/2 gallon of unknown oil
was found on 20 gallons of water in manhole 3007. Conduit plate #3d-2

indicates no sewer connection. Sample results returned as <1ppm PCBs.

Tanker removed 1/2 gallon of oil and 150 gallons of water from
manhole 3007. Flush crew triple washed manhole. Cleanup completed at
17:30Hrs on 9-16-00."

Remarks: "SAMPLE TAKE CLEAN UP PENDING RESULTS 1/2 PINT OF PRODUCT SPILLED
CONFINED TO MANHOLE CON ED 133435 "

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104789615 **DIST/DIR:** 0.065 East **ELEVATION:** 18 **MAP ID:** I82

NAME: MANHOLE 3007

Rev: 08/09/2021

ADDRESS: BRUCKNER BL/ST ANNES AV
BRONX, NY
BRONX

ID/Status: 0007117 / 2000-10-27
ID/Status: 284375
ID/Status: 2000-09-16

SOURCE: NY Department of Environmental Conservation

All Materials:

Site ID: 284375

Operable Unit ID: 827972

Operable Unit: 01

Material ID: 548218

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106968538 **DIST/DIR:** 0.065 East **ELEVATION:** 18 **MAP ID:** I83

NAME: MANHOLE 22004

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/ SAINT ANNE
BRONX, NY
BRONX

ID/Status: 0502781 / 2005-08-19

ID/Status: 347214

ID/Status: 2005-06-07

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 22004

Address: BRUCKNER BLVD/ SAINT ANNE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0502781 / 2005-08-19

Facility ID: 0502781

Facility Type: ER

DER Facility ID: 293517

Site ID: 347214

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 2005-06-07

Investigator: SKARAKHA

Referred To: Not reported

Reported to Dept: 2005-06-08

CID: 409

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2005-06-08

Spill Record Last Update: 2005-08-19

Spiller Name: ERT DESK MIKE DAUGHTERY

Spiller Company: MANHOLE 22004

Spiller Address: BRUCKNER BOUL/ SAINT ANNE

Spiller Company: 001

Contact Name: ERT DESK MIKE DAUGHTERY

DEC Memo: "e2mis no 159000 Ralph Herbstuzber 52167 reported discovering 1 qt of

unk oil on 300 gals of water contained in MH-22004 while insoecting

for dead 3m73. No release to sewer or waters. Env yellow tag 46354

placed in MH. Sample for oil ID and PCB's taken on coc EE05407. Lab

Sequence Number: 05-05419-001 - PCBs < 1 ppm Lab Sequence Number:

05-05420-001 - Analysis indicates the presence of a substance similar

to a dielectric fluid. 08-June-2005 02:30hrs. Env. Flush A-mech D.

Rodrigues 01075 reports cleanup complete. Structure located and

confirmed through the use of VISIONS mapping. Structure found dry

with no env. tag present. Certification tag placed by FOD department

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106968538 **DIST/DIR:** 0.065 East **ELEVATION:** 18 **MAP ID:** I83

NAME: MANHOLE 22004

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/ SAINT ANNE
BRONX, NY
BRONX

ID/Status: 0502781 / 2005-08-19

ID/Status: 347214

ID/Status: 2005-06-07

SOURCE: NY Department of Environmental Conservation

confirmed location as MH 22004 and feeder Dead 3M73. Structure double washed and rinsed using 760 biogen soap. CFS tanker took on 100 gallons of wash water, no debris generated, for transport and disposal at Astoria WWTF. 08-Jun-2005 08:41 Due to the issues concerning no Env tag and no water found in the manhole this spill will be changed to a reportable spill. Pending further investigation to determine where the proper manhole is and a crew to clean it. 27-June-2005 11:24 Hrs. Sr. EHS Specialist Larry Fischer, 55784, reported that he inspected Manhole 22004 and found it clean and free of oil, then the checked manhole 29870 at Saint Ann's Place and found Environmental Tag 46354 and there is no presense of oil in the manhole - water contained in the manhole is crystall clear. It is highly likely crews initially hung the Environmetnal Tag in the wrong manhole. Based on today's inspection and past cleaning in manole 22004 where there had been a damaged and leaking oil-containing feeder that was cleaned, this incident is being closed. The Environmental Tag has been removed from Manhole 29870. J.Siesfeld 84253 Closed. 8-19-05. George Breen "

Remarks: "1 QUART.CON ED#159000"

All Materials:

Site ID: 347214

Operable Unit ID: 1104954

Operable Unit: 01

Material ID: 1262280

Material Code: 0541A

Material Name: dielectric fluid

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104651643 **DIST/DIR:** 0.065 East **ELEVATION:** 18 **MAP ID:** I84

NAME: MANHOLE # 29670

Rev: 08/09/2021

ADDRESS: ST ANNES AVE/BRUCKNER AV
BRONX, NY
BRONX

ID/Status: 0000300 / 2002-01-17

ID/Status: 324431

ID/Status: 2000-04-07

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE # 29670

Address: ST ANNES AVE/BRUCKNER AV

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0000300 / 2002-01-17

Facility ID: 0000300

Facility Type: ER

DER Facility ID: 261324

Site ID: 324431

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2000-04-07

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 2000-04-07

CID: 281

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2000-04-07

Spill Record Last Update: 2002-01-23

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: RICHARD ROACH

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL Con Ed e2mis #130801 Notes: 4-7-00 1030hrs 1pt unknown oil

on 1000gal water in manhole 29670. Water level is constant and

conduit plates indicate no sewer connections. Sample taken. 4-7-00

Manhole number is actually 29870. 4-8-00 0645hrs LSN 00-03414 <1ppm

PCB 4-11-00 Cleanup complete. 1pt oil and 790 gal water removed from

manhole. Double washed manhole. Cement sump was sealed. No sewer

connection."

Remarks: "ABOVE MATERIAL DISCOVERED ON TOP OF 1000 GALLONS OF WATER AT ABOVE
LOCATION. AMOUNT REPORTED AS 1 PINT. SAMPLE TAKEN CLEANUP PENDING LAB

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104651643 **DIST/DIR:** 0.065 East **ELEVATION:** 18 **MAP ID:** I84

NAME: MANHOLE # 29670

Rev: 08/09/2021

ADDRESS: ST ANNES AVE/BRUCKNER AV
BRONX, NY
BRONX

ID/Status: 0000300 / 2002-01-17

ID/Status: 324431

ID/Status: 2000-04-07

SOURCE: NY Department of Environmental Conservation

RESULTS. CON ED # 130801 NO CALL BACK REQEUSTED."

All Materials:

Site ID: 324431

Operable Unit ID: 822013

Operable Unit: 01

Material ID: 288552

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104789894 **DIST/DIR:** 0.065 East **ELEVATION:** 18 **MAP ID:** I85

NAME: MANHOLE 30007

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/ST ANNES PL
BRONX, NY
BRONX

ID/Status: 0007415 / 2001-11-28

ID/Status: 0009587 / 2001-05-07

ID/Status: 77860

ID/Status: 189903

ID/Status: 2000-09-25

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 30007

Address: BRUCKNER BLVD/ST ANNES PL

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0007415 / 2001-11-28

Facility ID: 0007415

Facility Type: ER

DER Facility ID: 72550

Site ID: 77860

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2000-09-25

Investigator: OKWUOHA

Referred To: Not reported

Reported to Dept: 2000-09-25

CID: 398

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Local Agency

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2000-09-25

Spill Record Last Update: 2001-11-28

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: MARK SCHLAGEL

DEC Memo: ""

Remarks: "SPILL OCCURED ON 3 GALLONS OF WATER. CON ED 133559. NO CALL BACK.
CLEAN UP PENDING RESULTS."

All Materials:

Site ID: 77860

Operable Unit ID: 830043

Operable Unit: 01

Material ID: 560462

Material Code: 0066A

Material Name: unknown petroleum

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104789894	DIST/DIR: 0.065 East	ELEVATION: 18	MAP ID: I85

NAME: MANHOLE 30007

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/ST ANNES PL
BRONX, NY
BRONX

ID/Status: 0007415 / 2001-11-28

ID/Status: 0009587 / 2001-05-07

ID/Status: 77860

ID/Status: 189903

ID/Status: 2000-09-25

SOURCE: NY Department of Environmental Conservation

Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: MANHOLE 30007
Address: BRUCKNER BLVD/ST ANNE PL
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 0009587 / 2001-05-07
Facility ID: 0009587
Facility Type: ER
DER Facility ID: 158478
Site ID: 189903
DEC Region: 2
Spill Cause: Unknown
Spill Class: C4
SWIS: 0301
Spill Date: 2000-11-21
Investigator: KMFOLEY
Referred To: Not reported
Reported to Dept: 2000-11-21
CID: 397
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2000-11-21
Spill Record Last Update: 2001-06-18
Spiller Name: UNKNOWN
Spiller Company: Unknown
Spiller Address: UNKNOWN
Spiller Company: 999
Contact Name: CALLER
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
FOLEY DEC INSPECTOR'S NOTES CON ED E2MIS REPORT 11-21-00 Underground
Mechanic S. Sforza performing a routine inspection in MH3007 found 1
pt. of unknown oil in 5gals. of water. Conduit Plate #3-D indicates

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104789894 **DIST/DIR:** 0.065 East **ELEVATION:** 18 **MAP ID:** I85

NAME: MANHOLE 30007

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/ST ANNES PL
BRONX, NY
BRONX

ID/Status: 0007415 / 2001-11-28

ID/Status: 0009587 / 2001-05-07

ID/Status: 77860

ID/Status: 189903

SOURCE: NY Department of Environmental Conservation

ID/Status: 2000-09-25

no sewer connection. Water sample ; Aroclor 1260 <1.00ppm Orlando
Negron reports cleanup is completed. 1pt. of oil removed from loor of
manhole. Hole was double washed. No sewer connection. Aroclor 1242
1ppm Aroclor 1248 1ppm Aroclor 1254 1ppm Aroclor 1260 1ppm"

Remarks: "discovered 1 pt of unk oil clean is pending"

All Materials:

Site ID: 189903

Operable Unit ID: 831866

Operable Unit: 01

Material ID: 560448

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104881257 **DIST/DIR:** 0.065 East **ELEVATION:** 18 **MAP ID:** I86

NAME: MANHOLE #22002

Rev: 08/09/2021

ADDRESS: E 133RD ST/ST ANN AVE
BRONX, NY
BRONX

ID/Status: 0010663 / 2001-07-05

ID/Status: 315567

ID/Status: 2000-12-23

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE #22002

Address: E 133RD ST/ST ANN AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0010663 / 2001-07-05

Facility ID: 0010663

Facility Type: ER

DER Facility ID: 254415

Site ID: 315567

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2000-12-23

Investigator: OKWUOHA

Referred To: Not reported

Reported to Dept: 2000-12-23

CID: 281

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2000-12-23

Spill Record Last Update: 2001-07-16

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: ANTHONY NATALE

DEC Memo: ""

Remarks: "ABOVE MATERIAL DISCOVERED AT ABOVE LOCATION. CREW ON SCENE AND
CLEANUP IS IN PROGRESS. MATERIAL BEING TREATED AS 50/499 PPM. AMOUNT
IS REPORTED AS 1 PINT. CON ED # 134871. MATERIAL IS ON TOP OF 250
GALLONS OF WATER."

All Materials:

Site ID: 315567

Operable Unit ID: 832705

Operable Unit: 01

Material ID: 568937

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104881257 **DIST/DIR:** 0.065 East **ELEVATION:** 18 **MAP ID:** I86

NAME: MANHOLE #22002

Rev: 08/09/2021

ADDRESS: E 133RD ST/ST ANN AVE
BRONX, NY
BRONX

ID/Status: 0010663 / 2001-07-05
ID/Status: 315567
ID/Status: 2000-12-23

SOURCE: NY Department of Environmental Conservation

Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1014918457	DIST/DIR: 0.065 East	ELEVATION: 18	MAP ID: I87

NAME: CON EDISON MANHOLE 21998 ADDRESS: ST ANNS AVE & BRUCKNER BLVD BRONX, NY 10454 BRONX SOURCE: US Environmental Protection Agency	Rev: 09/13/2021 ID/Status: NYP004220711

RCRA NonGen / NLR:
 Date Form Received by Agency: 20101225
 Handler Name: CON EDISON MANHOLE 21998
 Handler Address: ST ANNS AVE & BRUCKNER BLVD
 Handler City,State,Zip: BRONX, NY 10454
 EPA ID: NYP004220711
 Contact Name: DONALD SENNO
 Contact Address: Not reported
 Contact City,State,Zip: Not reported
 Contact Telephone: 914-925-6219
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: SR SPECIALIST
 EPA Region: 02
 Land Type: Private
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R2
 Mailing Address: IRVING PL RM 828
 Mailing City,State,Zip: NEW YORK, NY 10003
 Owner Name: Not reported
 Owner Type: Not reported
 Operator Name: Not reported
 Operator Type: Not reported
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1014918457 **DIST/DIR:** 0.065 East **ELEVATION:** 18 **MAP ID:** I87

NAME: CON EDISON MANHOLE 21998

Rev: 09/13/2021

ADDRESS: ST ANNS AVE & BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYP004220711

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20110701
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20101125
Handler Name: CON EDISON MANHOLE 21998

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1014918457 **DIST/DIR:** 0.065 East **ELEVATION:** 18 **MAP ID:** I87

NAME: CON EDISON MANHOLE 21998

Rev: 09/13/2021

ADDRESS: ST ANNS AVE & BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYP004220711

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

Receive Date: 20101225

Handler Name: CON EDISON MANHOLE 21998

Federal Waste Generator Description: Not a generator, verified

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: Yes

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S102238615 **DIST/DIR:** 0.066 East **ELEVATION:** 18 **MAP ID:** I88

NAME: MERIT GAS STATION

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD / ST ANNS
BRONX, NY
BRONX

ID/Status: 9512219 / 1995-12-29

ID/Status: 232425

ID/Status: 1995-12-29

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MERIT GAS STATION

Address: BRUCKNER BLVD / ST ANNS

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9512219 / 1995-12-29

Facility ID: 9512219

Facility Type: ER

DER Facility ID: 191549

Site ID: 232425

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 1995-12-29

Investigator: MMMULQUE

Referred To: Not reported

Reported to Dept: 1995-12-29

CID: 357

Water Affected: Not reported

Spill Source: Gasoline Station or other PBS Facility

Spill Notifier: Citizen

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1995-12-29

Spill Record Last Update: 1996-02-01

Spiller Name: NONE

Spiller Company: MERIT GAS STATION

Spiller Address: BRUCKNER BLVD / ST ANNS

Spiller Company: 001

Contact Name: NONE

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

MULQUEEN CALLED MERIT -STATION SMALL SPILL CAUSED BY FILTER CHANGE ON
PUMP. GASOLINE PICKED UP WITH SPEEDY DRY."

Remarks: "anonamous caller reported gasoline spilled in lot of gas station"

All Materials:

Site ID: 232425

Operable Unit ID: 1023163

Operable Unit: 01

Material ID: 359536

Material Code: 0009

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S102238615 **DIST/DIR:** 0.066 East **ELEVATION:** 18 **MAP ID:** I88

NAME: MERIT GAS STATION

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD / ST ANNS
BRONX, NY
BRONX

ID/Status: 9512219 / 1995-12-29
ID/Status: 232425
ID/Status: 1995-12-29

SOURCE: NY Department of Environmental Conservation

Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 10.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S109208238 **DIST/DIR:** 0.067 NE **ELEVATION:** 18 **MAP ID:** M89

NAME: 208967; OPP 534-536 E134 ST & BROOK AVE

Rev: 08/09/2021

ADDRESS: OPP 534-536 E134 ST & BROOK AVE
BRONX, NY
BRONX

ID/Status: 0890404 / 2010-08-16

ID/Status: 399492

ID/Status: 2007-11-26

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: 208967; OPP 534-536 E134 ST & BROOK AVE

Address: OPP 534-536 E134 ST & BROOK AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0890404 / 2010-08-16

Facility ID: 0890404

Facility Type: ER

DER Facility ID: 348789

Site ID: 399492

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: D4

SWIS: 0301

Spill Date: 2007-11-26

Investigator: JMZALEWS

Referred To: Not reported

Reported to Dept: 2008-01-16

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: Not reported

Remediation Phase: 0

Date Entered In Computer: 2008-06-12

Spill Record Last Update: 2010-08-16

Spiller Name: ERT DESK

Spiller Company: CON EDISON

Spiller Address: 5030 BROADWAY

Spiller Company: 001

Contact Name: ERT DESK

DEC Memo: "08/16/2010 See eDocs for Con Ed report detailing cleanup and closure
DMP"

Remarks: "MH6162 ~ 1pint of dielectric fluid to concrete floor of structure

Pending: Cleanup"

All Materials:

Site ID: 399492

Operable Unit ID: 1156358

Operable Unit: 01

Material ID: 2147237

Material Code: 0541A

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S109208238	DIST/DIR:	0.067 NE	ELEVATION:	18	MAP ID:	M89

NAME: 208967; OPP 534-536 E134 ST & BROOK AVE

Rev: 08/09/2021

ADDRESS: OPP 534-536 E134 ST & BROOK AVE
BRONX, NY
BRONX

ID/Status: 0890404 / 2010-08-16

ID/Status: 399492

ID/Status: 2007-11-26

SOURCE: NY Department of Environmental Conservation

Material Name: dielectric fluid

Case No.: Not reported

Material FA: Petroleum

Quantity: .13

Units: G

Recovered: Not reported

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003200565 **DIST/DIR:** 0.067 NNW **ELEVATION:** 19 **MAP ID:** G90

NAME: BARAK SPEEDY LUBE **Rev:** 06/21/2021
ADDRESS: 115 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

UST:

Name: BARAK SPEEDY LUBE
Address: 115 BRUCKNER BOULEVARD
City,State,Zip: BRONX, NY 10454
Id/Status: 2-603099 / Active
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: 08/15/2022
UTM X: 590921.69210
UTM Y: 4517641.34552
Site Type: Other Wholesale/Retail Sales

Affiliation Records:

Site Id: 25051
Affiliation Type: Mail Contact
Company Name: URSUS MANAGEMENT CORP.
Contact Type: Not reported
Contact Name: DOVI LACHMI
Address1: 3220 ARLINGTON AVENUE
Address2: Not reported
City: BRONX
State: NY
Zip Code: 10463
Country Code: 001
Phone: (718) 549-1778
EMail: Not reported
Fax Number: Not reported
Modified By: MFLEONAR
Date Last Modified: 2017-09-26

Site Id: 25051
Affiliation Type: Facility Operator
Company Name: BARAK SPEEDY LUBE
Contact Type: Not reported
Contact Name: DOVI LACHMI
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 993-5215
EMail: Not reported
Fax Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003200565 **DIST/DIR:** 0.067 NNW **ELEVATION:** 19 **MAP ID:** G90

NAME: BARAK SPEEDY LUBE **Rev:** 06/21/2021
ADDRESS: 115 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Modified By: NRLOMBAR
Date Last Modified: 2011-11-15

Site Id: 25051
Affiliation Type: Emergency Contact
Company Name: MARTIN TAUB
Contact Type: Not reported
Contact Name: DOVI LACHMI
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 993-5215
Email: Not reported
Fax Number: Not reported
Modified By: MFLEONAR
Date Last Modified: 2017-09-26

Site Id: 25051
Affiliation Type: Facility Owner
Company Name: MARTIN TAUB
Contact Type: PRESIDENT
Contact Name: BARAK SPEEDY LUBE INC.
Address1: 3 RIVERCREST ROAD
Address2: Not reported
City: RIVERDALE
State: NY
Zip Code: 10471
Country Code: 001
Phone: (718) 544-1778
Email: Not reported
Fax Number: Not reported
Modified By: MFLEONAR
Date Last Modified: 2017-09-26

Tank Info:

Tank Number: 001
Tank ID: 53058
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 2000

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003200565 **DIST/DIR:** 0.067 NNW **ELEVATION:** 19 **MAP ID:** G90

NAME: BARAK SPEEDY LUBE **Rev:** 06/21/2021
ADDRESS: 115 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Install Date: 11/01/1988
Date Tank Closed: 04/28/2009
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0013
Common Name of Substance: Lube Oil

Tightness Test Method: 21
Date Test: 01/29/2008
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MFLEONAR
Last Modified: 09/26/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
F00 - Pipe External Protection - None
H04 - Tank Leak Detection - Groundwater Well
L00 - Piping Leak Detection - None
E00 - Piping Secondary Containment - None
A01 - Tank Internal Protection - Epoxy Liner
K00 - Spill Prevention - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B01 - Tank External Protection - Painted/Asphalt Coating
I05 - Overfill - Vent Whistle
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 002
Tank ID: 53059
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 2000
Install Date: 11/01/1988
Date Tank Closed: 04/28/2009
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0013
Common Name of Substance: Lube Oil

Tightness Test Method: 21
Date Test: 01/29/2008

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003200565 DIST/DIR: 0.067 NNW ELEVATION: 19 MAP ID: G90

NAME: BARAK SPEEDY LUBE Rev: 06/21/2021
ADDRESS: 115 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MFLEONAR
Last Modified: 09/26/2017

Equipment Records:

F00 - Pipe External Protection - None
H04 - Tank Leak Detection - Groundwater Well
L00 - Piping Leak Detection - None
K00 - Spill Prevention - None
J02 - Dispenser - Suction Dispenser
E00 - Piping Secondary Containment - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
I05 - Overfill - Vent Whistle
C02 - Pipe Location - Underground/On-ground
A01 - Tank Internal Protection - Epoxy Liner
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Number: 003
Tank ID: 53060
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 2000
Install Date: 11/01/1988
Date Tank Closed: 04/28/2009
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0013
Common Name of Substance: Lube Oil

Tightness Test Method: 21
Date Test: 01/29/2008
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: NRLOMBAR
Last Modified: 04/14/2017

Equipment Records:

F00 - Pipe External Protection - None
H04 - Tank Leak Detection - Groundwater Well
L00 - Piping Leak Detection - None
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction Dispenser

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003200565 **DIST/DIR:** 0.067 NNW **ELEVATION:** 19 **MAP ID:** G90

NAME: BARAK SPEEDY LUBE **Rev:** 06/21/2021
ADDRESS: 115 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

A01 - Tank Internal Protection - Epoxy Liner
E00 - Piping Secondary Containment - None
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron
K00 - Spill Prevention - None
G04 - Tank Secondary Containment - Double-Walled (Underground)
I05 - Overfill - Vent Whistle

Tank Number: 004
Tank ID: 53061
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 1000
Install Date: 11/01/1988
Date Tank Closed: 04/28/2009
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0022
Common Name of Substance: Waste Oil/Used Oil

Tightness Test Method: 21
Date Test: 01/29/2008
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: NRLOMBAR
Last Modified: 04/14/2017

Equipment Records:
F00 - Pipe External Protection - None
H04 - Tank Leak Detection - Groundwater Well
G04 - Tank Secondary Containment - Double-Walled (Underground)
C02 - Pipe Location - Underground/On-ground
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron
A01 - Tank Internal Protection - Epoxy Liner
E00 - Piping Secondary Containment - None
L00 - Piping Leak Detection - None
J02 - Dispenser - Suction Dispenser
K00 - Spill Prevention - None
I05 - Overfill - Vent Whistle

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1017776626	DIST/DIR: 0.067 NNW	ELEVATION: 19	MAP ID: G91

NAME: CON EDISON SERVICE BOX: 21946

Rev: 09/13/2021

ADDRESS: 115 BRUCKNER BLVD FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004544896

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20140628
 Handler Name: CON EDISON SERVICE BOX: 21946
 Handler Address: 115 BRUCKNER BLVD FRONT OF
 Handler City,State,Zip: BRONX, NY 10454
 EPA ID: NYP004544896
 Contact Name: THOMAS TEELING
 Contact Address: Not reported
 Contact City,State,Zip: Not reported
 Contact Telephone: 212-460-3770
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: SENIOR SCIENTIST
 EPA Region: 02
 Land Type: Private
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R2
 Mailing Address: IRVING PL, 15TH FL NE
 Mailing City,State,Zip: NEW YORK, NY 10003
 Owner Name: Not reported
 Owner Type: Not reported
 Operator Name: Not reported
 Operator Type: Not reported
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1017776626 **DIST/DIR:** 0.067 NNW **ELEVATION:** 19 **MAP ID:** G91

NAME: CON EDISON SERVICE BOX: 21946

Rev: 09/13/2021

ADDRESS: 115 BRUCKNER BLVD FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004544896

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150211
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20140528
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1017776626 **DIST/DIR:** 0.067 NNW **ELEVATION:** 19 **MAP ID:** G91

NAME: CON EDISON SERVICE BOX: 21946

Rev: 09/13/2021

ADDRESS: 115 BRUCKNER BLVD FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004544896

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20140528
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20140628
Handler Name: CON EDISON SERVICE BOX: 21946
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1017776626 **DIST/DIR:** 0.067 NNW **ELEVATION:** 19 **MAP ID:** G91

NAME: CON EDISON SERVICE BOX: 21946

Rev: 09/13/2021

ADDRESS: 115 BRUCKNER BLVD FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004544896

SOURCE: US Environmental Protection Agency

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019325547 **DIST/DIR:** 0.069 WNW **ELEVATION:** 22 **MAP ID:** H92

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & BROWN PL
BRONX, NY 10475
BRONX

ID/Status: NYP004836910

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150910

Handler Name: CON EDISON

Handler Address: E 132ND ST & BROWN PL

Handler City,State,Zip: BRONX, NY 10475

EPA ID: NYP004836910

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019325547 **DIST/DIR:** 0.069 WNW **ELEVATION:** 22 **MAP ID:** H92

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & BROWN PL
BRONX, NY 10475
BRONX

ID/Status: NYP004836910

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Biennial: List of Years
Year: 2015

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019325547 **DIST/DIR:** 0.069 WNW **ELEVATION:** 22 **MAP ID:** H92

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & BROWN PL
BRONX, NY 10475
BRONX

ID/Status: NYP004836910

SOURCE: US Environmental Protection Agency

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code: D008

Waste Description: LEAD

Handler - Owner Operator:

Owner/Operator Indicator: Owner

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20150910

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20150910

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20160205

Handler Name: CON EDISON - TRANSFORMER MANHOLE 694

Federal Waste Generator Description: Large Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019325547 **DIST/DIR:** 0.069 WNW **ELEVATION:** 22 **MAP ID:** H92

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: E 132ND ST & BROWN PL
BRONX, NY 10475
BRONX

ID/Status: NYP004836910

SOURCE: US Environmental Protection Agency

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150910
Handler Name: CON EDISON
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150910
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 221122
NAICS Description: ELECTRIC POWER DISTRIBUTION

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S105234929	DIST/DIR: 0.069 WNW	ELEVATION: 22	MAP ID: H93

NAME: SPILL NUMBER 0108461

Rev: 08/09/2021

ADDRESS: EAST 132ND ST & BROWN PL
BRONX, NY
BRONX

ID/Status: 0108461 / 2003-01-31

ID/Status: 214638

ID/Status: 2001-11-21

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: SPILL NUMBER 0108461

Address: EAST 132ND ST & BROWN PL

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0108461 / 2003-01-31

Facility ID: 0108461

Facility Type: ER

DER Facility ID: 177833

Site ID: 214638

DEC Region: 2

Spill Cause: Traffic Accident

Spill Class: C3

SWIS: 0301

Spill Date: 2001-11-21

Investigator: AERODRIG

Referred To: Not reported

Reported to Dept: 2001-11-21

CID: 266

Water Affected: Not reported

Spill Source: Commercial Vehicle

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2001-11-21

Spill Record Last Update: 2003-01-31

Spiller Name: Not reported

Spiller Company: CON EDISON

Spiller Address: 4 IRVING PLACE

Spiller Company: 001

Contact Name: Not reported

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was RODRIGUEZ E2MIS 140349 21-Nov.2001 @04:15 hrs. #9 Supervisor A.

Tortora # 39689 reports that while seperating the Flush truck # 60588 from another vehicle which were involved in an accident, the door of the tank on the flush leaked ~50 gallons of liquid lead waste onto the street. No smoke or fire involved, no sewers, waterways or private property involved. Area of spill contained and another flush truck is being dispatched to drain the affected truck and clean the area. 21-Nov. 2001 @ 04:37 CIG. J. Fox # 07887 notified 21-Nov.-2001 @ 04:30hrs. Spoke to ERT D. Shah regarding cleanup 21-Nov.2001 @

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S105234929 **DIST/DIR:** 0.069 WNW **ELEVATION:** 22 **MAP ID:** H93

NAME: SPILL NUMBER 0108461

Rev: 08/09/2021

ADDRESS: EAST 132ND ST & BROWN PL
BRONX, NY
BRONX

ID/Status: 0108461 / 2003-01-31

ID/Status: 214638

ID/Status: 2001-11-21

SOURCE: NY Department of Environmental Conservation

05:00 hrs OS. A. Tortora reports Area baracaded off and 60508 leak contained with removal of liquid. Second flush truck full and has to be emptied, but t on location until replacement arrives. Took damaged truck to flush pit to wash out and dispatched a second truck to the location to complete the cleanup. 21-Nov-2001 05:05 Flush Truck 60508 in Flush Pit, OS. Tortora reports flush gate baracaded and was instructed to remove same to gain access. 1-Nov-2001 06:45 Flush Mechanic J. Maloney reports that clean up is complete at this time. A 20' X 2' area was double washed. Speedy dry was applied, and removed by Environmental Detailed Incident Report replacement flush truck. Clean up is complete at this time. 21-Nov-2001 09:20 O.S. L. fischer #55784 reports that he is at Hell Gate Flush Pit inspecting damaged flush truck. Correction to earlier report flush truck number is 60588. Truck #60588 will be off loaded as soon as damaged door can be opened. This clean up is complete, and damaged truck will not leave pit until it is emptied, and washed down. This clean up is complete. 07-DEC-2001 08:55 Supervisor L. Fischer reports that he investigated material in vactor truck # 60588, records show no Hazardous lead waste was in the tanker when incident occurred. Records indicate only Bronx service boxes were flushed with this vehicle. "

Remarks: "LIQUID LEAD WASTE. ACCIDENT CAUSED LEAK FROM TANK DOOR OF LIQUID FLUSH TRUCK. SPILLED ONTO PAVED ROADWAY. NO SEWERS OR STORM DRAINS. ANOTHER TRUCK DISPATCHED TO OFF-LOAD THE AFFECTED TRUCK AND TO CLEAN THE AREA. CON EDISON REFERENCE NUMBER 140394."

All Materials:

Site ID: 214638

Operable Unit ID: 846504

Operable Unit: 01

Material ID: 529705

Material Code: 0030A

Material Name: lead

Case No.: 07439921

Material FA: Hazardous Material

Quantity: 50.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S117975261 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I94

NAME: EAST RIVER

Rev: 08/09/2021

ADDRESS: 158 BRUCKENER BLVD
BRONX, NY 10454
BRONX

ID/Status: 1503751 / 2015-07-08
ID/Status: 510068
ID/Status: 2015-07-07

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: EAST RIVER

Address: 158 BRUCKENER BLVD

City,State,Zip: BRONX, NY 10454

Spill Number/Closed Date: 1503751 / 2015-07-08

Facility ID: 1503751

Facility Type: ER

DER Facility ID: 464665

Site ID: 510068

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: E5

SWIS: 0301

Spill Date: 2015-07-07

Investigator: RMPIPER

Referred To: Not reported

Reported to Dept: 2015-07-07

CID: Not reported

Water Affected: EAST RIVER

Spill Source: Commercial/Industrial

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2015-07-07

Spill Record Last Update: 2015-07-08

Spiller Name: REARDON

Spiller Company: NYS DEP

Spiller Address: 158 BRUCKENER BLVD

Spiller Company: 999

Contact Name: REARDON

DEC Memo: "referred to DEC water. Closed."

Remarks: "over load causing bypass"

All Materials:

Site ID: 510068

Operable Unit ID: 1259341

Operable Unit: 01

Material ID: 2262634

Material Code: 0062A

Material Name: raw sewage

Case No.: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S117975261 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I94

NAME: EAST RIVER

Rev: 08/09/2021

ADDRESS: 158 BRUCKENER BLVD
BRONX, NY 10454
BRONX

ID/Status: 1503751 / 2015-07-08
ID/Status: 510068
ID/Status: 2015-07-07

SOURCE: NY Department of Environmental Conservation

Material FA: Other
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S109413343 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I95

NAME: 158 BRUKMER BLVD/ BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: 158 BRUKMER BLVD
BRONX, NY
BRONX

ID/Status: 0810149 / 2008-12-11

ID/Status: 407663

ID/Status: 2008-12-10

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: 158 BRUKMER BLVD/ BRONX GRIT CHAMBER

Address: 158 BRUKMER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0810149 / 2008-12-11

Facility ID: 0810149

Facility Type: ER

DER Facility ID: 356915

Site ID: 407663

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: Not reported

SWIS: 0301

Spill Date: 2008-12-10

Investigator: vszhune

Referred To: Not reported

Reported to Dept: 2008-12-10

CID: Not reported

Water Affected: EAST RIVER

Spill Source: Institutional, Educational, Gov., Other

Spill Notifier: Local Agency

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2008-12-10

Spill Record Last Update: 2008-12-11

Spiller Name: RON CASS

Spiller Company: NYC DEPT OF ENVIRONMENTAL PROTECTION

Spiller Address: 158 BRUKMER BLVD

Spiller Company: 999

Contact Name: RON CASS

DEC Memo: "Closed referred to water "

Remarks: "SCREEN FAILURE AT THE PUMP STATION."

All Materials:

Site ID: 407663

Operable Unit ID: 1164200

Operable Unit: 01

Material ID: 2155566

Material Code: 0060A

Material Name: wastewater

Case No.: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S109413343	DIST/DIR:	0.069 East	ELEVATION:	18	MAP ID:	I95

NAME: 158 BRUKMER BLVD/ BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: 158 BRUKMER BLVD
BRONX, NY
BRONX

ID/Status: 0810149 / 2008-12-11

ID/Status: 407663

ID/Status: 2008-12-10

SOURCE: NY Department of Environmental Conservation

Material FA: Other
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1001961585 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I96

NAME: NYC DEP BWT BRONX GRIT CHAMBER

Rev: 09/13/2021

ADDRESS: 158 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYR000083857

SOURCE: US Environmental Protection Agency

RCRA-LQG:

Date Form Received by Agency: 20120404
Handler Name: NYC DEP BWT BRONX GRIT CHAMBER
Handler Address: 158 BRUCKNER BLVD
Handler City,State,Zip: BRONX, NY 10454
EPA ID: NYR000083857
Contact Name: JOHN MCCABE
Contact Address: WARDS ISLAND
Contact City,State,Zip: WARDS ISLAND, NY 10035
Contact Telephone: 212-860-9351
Contact Fax: 212-860-9308
Contact Email: MCCABEJ@DEP.NYC.GOV
Contact Title: PLANT CHIEF
EPA Region: 02
Land Type: Municipal
Federal Waste Generator Description: Large Quantity Generator
Non-Notifier: Not reported
Biennial Report Cycle: 2011
Accessibility: Not reported
Active Site Indicator: Handler Activities
State District Owner: NY
State District: NYSDEC R2
Mailing Address: HORACE HARDING EXPY.,
Mailing City,State,Zip: CORONA, NY 11368
Owner Name: NYC ENVIRONMENTAL PROTECTION
Owner Type: Municipal
Operator Name: NYC ENVIRONMENTAL PROTECTION
Operator Type: Municipal
Short-Term Generator Activity: No
Importer Activity: No
Mixed Waste Generator: No
Transporter Activity: No
Transfer Facility Activity: No
Recycler Activity with Storage: No
Small Quantity On-Site Burner Exemption: No
Smelting Melting and Refining Furnace Exemption: No
Underground Injection Control: No
Off-Site Waste Receipt: No
Universal Waste Indicator: No
Universal Waste Destination Facility: No
Federal Universal Waste: No
Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
Active Site Converter Treatment storage and Disposal Facility: Not reported
Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1001961585 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I96

NAME: NYC DEP BWT BRONX GRIT CHAMBER

Rev: 09/13/2021

ADDRESS: 158 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYR000083857

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Biennial: List of Years
Year: 2011

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1001961585 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I96

NAME: NYC DEP BWT BRONX GRIT CHAMBER

Rev: 09/13/2021

ADDRESS: 158 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYR000083857

SOURCE: US Environmental Protection Agency

[Click Here for Biennial Reporting System Data:](#)

Year: 2003

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code: D002

Waste Description: CORROSIVE WASTE

Waste Code: D003

Waste Description: REACTIVE WASTE

Waste Code: D006

Waste Description: CADMIUM

Waste Code: D007

Waste Description: CHROMIUM

Waste Code: D008

Waste Description: LEAD

Handler - Owner Operator:

Owner/Operator Indicator: Operator

Owner/Operator Name: NYCDEP

Legal Status: Municipal

Date Became Current: 20030101

Date Ended Current: Not reported

Owner/Operator Address: Not reported

Owner/Operator City,State,Zip: Not reported

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: NYCDEP

Legal Status: Municipal

Date Became Current: 19371023

Date Ended Current: Not reported

Owner/Operator Address: Not reported

Owner/Operator City,State,Zip: Not reported

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1001961585 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I96

NAME: NYC DEP BWT BRONX GRIT CHAMBER

Rev: 09/13/2021

ADDRESS: 158 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYR000083857

SOURCE: US Environmental Protection Agency

Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NYC ENVIRONMENTAL PROTECTION
Legal Status: Municipal
Date Became Current: 19370101
Date Ended Current: Not reported
Owner/Operator Address: 9605 HORACE HARDING EXPY.,
Owner/Operator City,State,Zip: CORONA, NY 11368
Owner/Operator Telephone: 718-595-5068
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NYCDEP
Legal Status: Municipal
Date Became Current: 19371023
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NYCDEP-BWT
Legal Status: Municipal
Date Became Current: 20030101
Date Ended Current: Not reported
Owner/Operator Address: BRUCKNER BLVD
Owner/Operator City,State,Zip: BRONX, NY 10454
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: NYCDEP-BWT
Legal Status: Municipal
Date Became Current: 20030101
Date Ended Current: Not reported
Owner/Operator Address: BRUCKNER BLVD

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1001961585 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I96

NAME: NYC DEP BWT BRONX GRIT CHAMBER

Rev: 09/13/2021

ADDRESS: 158 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYR000083857

SOURCE: US Environmental Protection Agency

Owner/Operator City,State,Zip: BRONX, NY 10454

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: CITY OF NEW YORK DEPT OF ENVIRON PROTECT

Legal Status: Municipal

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: 96-05 HORACE HARDING EXPWY

Owner/Operator City,State,Zip: CORONA, NY 11368

Owner/Operator Telephone: 212-860-9304

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: NYCDEP-BWT

Legal Status: Municipal

Date Became Current: 20030101

Date Ended Current: Not reported

Owner/Operator Address: BRUCKNER BLVD

Owner/Operator City,State,Zip: BRONX, NY 10454

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: NYCDEP-BWT

Legal Status: Municipal

Date Became Current: 20030101

Date Ended Current: Not reported

Owner/Operator Address: BRUCKNER BLVD

Owner/Operator City,State,Zip: BRONX, NY 10454

Owner/Operator Telephone: Not reported

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: NYC ENVIRONMENTAL PROTECTION

Legal Status: Municipal

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1001961585 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I96

NAME: NYC DEP BWT BRONX GRIT CHAMBER

Rev: 09/13/2021

ADDRESS: 158 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYR000083857

SOURCE: US Environmental Protection Agency

Date Became Current: 19390101
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NYCDEP
Legal Status: Municipal
Date Became Current: 20030101
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20120404
Handler Name: NYC DEP BWT BRONX GRIT CHAMBER
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: NYCDEP-BWT BRONX GRIT CHAMBER
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1001961585 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I96

NAME: NYC DEP BWT BRONX GRIT CHAMBER

Rev: 09/13/2021

ADDRESS: 158 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYR000083857

SOURCE: US Environmental Protection Agency

Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: NYCDEP-BWT BRONX GRIT CHAMBER
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20000119
Handler Name: NYCDEP - BRONX GRIT CHAMBER
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080821
Handler Name: NYCDEP BWT BRONX GRIT
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20090609
Handler Name: NYCDEP BWT BRONX GRIT

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1001961585 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I96

NAME: NYC DEP BWT BRONX GRIT CHAMBER

Rev: 09/13/2021

ADDRESS: 158 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYR000083857

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20040227
Handler Name: NYCDEP-BWT BRONX GRIT CHAMBER
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 22132
NAICS Description: SEWAGE TREATMENT FACILITIES

NAICS Code: 23891
NAICS Description: SITE PREPARATION CONTRACTORS

Facility Has Received Notices of Violation:
Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1001961585 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I96

NAME: NYC DEP BWT BRONX GRIT CHAMBER

Rev: 09/13/2021

ADDRESS: 158 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYR000083857

SOURCE: US Environmental Protection Agency

Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:
Evaluation Date: 20030917
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYADS
Evaluation Responsible Sub-Organization: R2
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106969178	DIST/DIR: 0.069 East	ELEVATION: 18	MAP ID: I97

NAME: BRONX GRID CHAMBER

Rev: 08/09/2021

ADDRESS: 158 BRUCKNER BOULEVARD
BRONX, NY
BRONX

ID/Status: 0607426 / 2006-09-29

ID/Status: 0503678 / 2005-06-28

ID/Status: 0801139 / 2008-04-29

ID/Status: 371145

ID/Status: 348339

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: BRONX GRID CHAMBER

Address: 158 BRUCKNER BOULEVARD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0607426 / 2006-09-29

Facility ID: 0607426

Facility Type: ER

DER Facility ID: 294721

Site ID: 371145

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: Not reported

SWIS: 0301

Spill Date: 2006-09-28

Investigator: JBVOUGHT

Referred To: Not reported

Reported to Dept: 2006-09-28

CID: 78

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2006-09-28

Spill Record Last Update: 2006-09-29

Spiller Name: Not reported

Spiller Company: NYC DEP

Spiller Address: Not reported

Spiller Company: 001

Contact Name: RON CASS

DEC Memo: "09/29/06-Vought-Off hours responder. Vought spoke to Harold Grimes and spill was hydraulic oil on concrete and spill did not enter sewer drain and cleaned using speedy dry. Spill closed by Vought."

Remarks: "water gate hydraulic cylinder fractured cleaned with speedy dry "

All Materials:

Site ID: 371145

Operable Unit ID: 1128916

Operable Unit: 01

Material ID: 2118571

Material Code: 1101A

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106969178 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I97

NAME: BRONX GRID CHAMBER

Rev: 08/09/2021

ADDRESS: 158 BRUCKNER BOULEVARD
BRONX, NY
BRONX

ID/Status: 0607426 / 2006-09-29

ID/Status: 0503678 / 2005-06-28

ID/Status: 0801139 / 2008-04-29

ID/Status: 371145

ID/Status: 348339

SOURCE: NY Department of Environmental Conservation

Material Name: hydraulic acid

Case No.: Not reported

Material FA: Other

Quantity: 15.00

Units: G

Recovered: 15.00

Oxygenate: Not reported

Name: BRONX GRID CHAMBER

Address: 158 BRUCKNER BOULEVARD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0503678 / 2005-06-28

Facility ID: 0503678

Facility Type: ER

DER Facility ID: 294721

Site ID: 348339

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: D4

SWIS: 0301

Spill Date: 2005-06-27

Investigator: SMSANGES

Referred To: Not reported

Reported to Dept: 2005-06-27

CID: 408

Water Affected: EAST RIVER

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: Not reported

UST Trust: Not reported

Remediation Phase: 0

Date Entered In Computer: 2005-06-27

Spill Record Last Update: 2005-06-28

Spiller Name: MICHAEL KOWALSKI

Spiller Company: BRONX GRID CHAMBER

Spiller Address: 158 BRUCKNER BOULEVARD

Spiller Company: 001

Contact Name: MICHAEL KOWALSKI

DEC Memo: ""

Remarks: "DUE TO FAILURE OF BUZZ SCREENS, ONGOING"

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106969178 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I97

NAME: BRONX GRID CHAMBER

Rev: 08/09/2021

ADDRESS: 158 BRUCKNER BOULEVARD
BRONX, NY
BRONX

ID/Status: 0607426 / 2006-09-29

ID/Status: 0503678 / 2005-06-28

ID/Status: 0801139 / 2008-04-29

ID/Status: 371145

ID/Status: 348339

SOURCE: NY Department of Environmental Conservation

All Materials:

Site ID: 348339

Operable Unit ID: 1105995

Operable Unit: 01

Material ID: 1968488

Material Code: 0062A

Material Name: raw sewage

Case No.: Not reported

Material FA: Other

Quantity: Not reported

Units: G

Recovered: .00

Oxygenate: Not reported

Name: 158 BRUCKNER BLVD

Address: 158 BRUCKNER BOULEVARD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0801139 / 2008-04-29

Facility ID: 0801139

Facility Type: ER

DER Facility ID: 294721

Site ID: 397013

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 2008-04-28

Investigator: smsanges

Referred To: Not reported

Reported to Dept: 2008-04-28

CID: 79

Water Affected: Not reported

Spill Source: Major Facility (MOSF) > 400,000 gal

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: Not reported

Remediation Phase: 0

Date Entered In Computer: 2008-04-29

Spill Record Last Update: 2008-04-29

Spiller Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106969178 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I97

NAME: BRONX GRID CHAMBER

Rev: 08/09/2021

ADDRESS: 158 BRUCKNER BOULEVARD
BRONX, NY
BRONX

ID/Status: 0607426 / 2006-09-29

ID/Status: 0503678 / 2005-06-28

ID/Status: 0801139 / 2008-04-29

ID/Status: 371145

ID/Status: 348339

SOURCE: NY Department of Environmental Conservation

Spiller Company: Not reported

Spiller Address: Not reported

Spiller Company: 001

Contact Name: RON CASS

DEC Memo: ""

Remarks: "SPILL INTO EAST RIVER. UNABLE TO PUMP TWO TIMES DESIGN FLOW DUE TO
SCREEN FAILURE. SPILL IS ONGOING."

All Materials:

Site ID: 397013

Operable Unit ID: 1153977

Operable Unit: 01

Material ID: 2144760

Material Code: 0062A

Material Name: raw sewage

Case No.: Not reported

Material FA: Other

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U004198816 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I98

NAME: BRONX GRIT CHAMBER **Rev:** 06/21/2021

ADDRESS: 158 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

UST:

Name: BRONX GRIT CHAMBER
Address: 158 BRUCKNER BOULEVARD
City,State,Zip: BRONX, NY 10454
Id/Status: 2-601499 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: N/A
UTM X: 591193.87684
UTM Y: 4517459.03273
Site Type: Utility (Other than Municipal)

Tank Info:

Tank Number: 001
Tank ID: 46464
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 7500
Install Date: 06/01/1971
Date Tank Closed: 03/02/2004
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Tightness Test Method: 00
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: NRLOMBAR
Last Modified: 04/14/2017

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S113818114 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I99

NAME: WASTE WATER BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: 158 BRUCKNER AVE.
BRONX, NY
BRONX

ID/Status: 1302966 / 2013-06-19
ID/Status: 483422
ID/Status: 2013-06-18

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: WASTE WATER BRONX GRIT CHAMBER

Address: 158 BRUCKNER AVE.

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 1302966 / 2013-06-19

Facility ID: 1302966

Facility Type: ER

DER Facility ID: 438635

Site ID: 483422

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 2013-06-18

Investigator: TJDEMEO

Referred To: Not reported

Reported to Dept: 2013-06-18

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2013-06-18

Spill Record Last Update: 2013-06-19

Spiller Name: GREG BEACH

Spiller Company: CONTRACTOR

Spiller Address: 158 BRUCKNER AVE.

Spiller Company: 999

Contact Name: GREG BEACH

DEC Memo: "6/19/13 TJD Small antifreeze spill to concrete. All cleaned. No further action required."

Remarks: "concrete floor only - cleaned up"

All Materials:

Site ID: 483422

Operable Unit ID: 1233135

Operable Unit: 01

Material ID: 2232010

Material Code: 0043A

Material Name: antifreeze

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S113818114 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I99

NAME: WASTE WATER BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: 158 BRUCKNER AVE.

ID/Status: 1302966 / 2013-06-19

BRONX, NY

ID/Status: 483422

BRONX

ID/Status: 2013-06-18

SOURCE: NY Department of Environmental Conservation

Case No.: Not reported

Material FA: Other

Quantity: 2.50

Units: G

Recovered: Not reported

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104191616 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I100

NAME: NYCDEP BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0505949 / 2005-08-15
ID/Status: 0313238 / 2009-05-01
ID/Status: 0400675 / 2004-04-21
ID/Status: 0810210 / 2008-12-12
ID/Status: 0410975 / 2005-01-11

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: BRONX GRID CHAMBER
Address: 158 BRUCKNER BLVD
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 0505949 / 2005-08-15
Facility ID: 0505949
Facility Type: ER
DER Facility ID: 298313
Site ID: 351054
DEC Region: 2
Spill Cause: Equipment Failure
Spill Class: C3
SWIS: 2401
Spill Date: 2005-08-14
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 2005-08-14
CID: 73
Water Affected: EAST RIVER
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Not reported
UST Trust: Not reported
Remediation Phase: 0
Date Entered In Computer: 2005-08-15
Spill Record Last Update: 2005-08-15
Spiller Name: HAROLD GRIMES
Spiller Company: BRONX GRID CHAMBER
Spiller Address: 158 BRUCKNER BLVD
Spiller Company: 001
Contact Name: HAROLD GRIMES
DEC Memo: ""
Remarks: "SEWER BYPASS - ONGOING."

All Materials:

Site ID: 351054
Operable Unit ID: 1108591
Operable Unit: 01
Material ID: 2098533
Material Code: 0062A
Material Name: raw sewage
Case No.: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104191616 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I100

NAME: NYCDEP BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0505949 / 2005-08-15
ID/Status: 0313238 / 2009-05-01
ID/Status: 0400675 / 2004-04-21
ID/Status: 0810210 / 2008-12-12
ID/Status: 0410975 / 2005-01-11

SOURCE: NY Department of Environmental Conservation

Material FA: Other
Quantity: Not reported
Units: G
Recovered: .00
Oxygenate: Not reported

Name: NYCDEP BRONX GRIT CHAMBER
Address: 158 BRUCKNER BLVD
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 0313238 / 2009-05-01
Facility ID: 0313238
Facility Type: ER
DER Facility ID: 118523
Site ID: 138621
DEC Region: 2
Spill Cause: Unknown
Spill Class: C4
SWIS: 0301
Spill Date: 2004-03-02
Investigator: JMKRIMGO
Referred To: Not reported
Reported to Dept: 2004-03-02
CID: 403
Water Affected: Not reported
Spill Source: Non Major Facility > 1,100 gal
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2004-03-02
Spill Record Last Update: 2009-05-01
Spiller Name: ANDREW PECORARO
Spiller Company: Not reported
Spiller Address: 158 BRUCKNER BLVD
Spiller Company: 001
Contact Name: ANDREW PECORARO
DEC Memo: "5/1/09. J.Krimgold reviewed two reports dated March 30, 2004 and November 23, 2004 prepared by Garnett Fleming. Based on the data submitted, marginal contaminant concentrations above TAGM levels was found in one soil sample. Subsequent ground water sampling reveal no contamination in the GW. NFA."

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104191616 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I100

NAME: NYCDEP BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0505949 / 2005-08-15
ID/Status: 0313238 / 2009-05-01
ID/Status: 0400675 / 2004-04-21
ID/Status: 0810210 / 2008-12-12
ID/Status: 0410975 / 2005-01-11

SOURCE: NY Department of Environmental Conservation

Remarks: "they discovered oil in one of the borings around the tank. clean up has not started yet. they are waiting for the test results of the soil."

All Materials:

Site ID: 138621
Operable Unit ID: 878479
Operable Unit: 01
Material ID: 498396
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: L
Recovered: .00
Oxygenate: Not reported

Name: BRONX GRID CHAMBER
Address: 158 BRUCKNER BLVD
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 0400675 / 2004-04-21
Facility ID: 0400675
Facility Type: ER
DER Facility ID: 118523
Site ID: 138622
DEC Region: 2
Spill Cause: Human Error
Spill Class: D4
SWIS: 0301
Spill Date: 2004-04-13
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 2004-04-20
CID: 407
Water Affected: Not reported
Spill Source: Major Facility (MOSF) > 400,000 gal
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104191616 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I100

NAME: NYCDEP BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0505949 / 2005-08-15
ID/Status: 0313238 / 2009-05-01
ID/Status: 0400675 / 2004-04-21
ID/Status: 0810210 / 2008-12-12
ID/Status: 0410975 / 2005-01-11

SOURCE: NY Department of Environmental Conservation

Date Entered In Computer: 2004-04-20

Spill Record Last Update: 2004-05-03

Spiller Name: JIM MARROW

Spiller Company: PICONE MCULLAH

Spiller Address: 31 GARDEN LANE

Spiller Company: 001

Contact Name: JOE REDDINGTON

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
SANGESLAND non regulated material"

Remarks: "Durning renovation the contractor turned off the HVAC system, and
they put a hazardous material on the floor at this location, which
went into a channel which drained into a sewer. The product is called
815 Lemon disinfectant made by arrow chemical corp. The label on the
product clearly states that it should not be allowed to be drained
into any sewer system."

All Materials:

Site ID: 138622

Operable Unit ID: 882775

Operable Unit: 01

Material ID: 491918

Material Code: 0064A

Material Name: unknown material

Case No.: Not reported

Material FA: Other

Quantity: 5.00

Units: G

Recovered: .00

Oxygenate: Not reported

Name: BRONX GRIT CHAMBER

Address: 158 BRUCKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0810210 / 2008-12-12

Facility ID: 0810210

Facility Type: ER

DER Facility ID: 118523

Site ID: 407725

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: D5

SWIS: 0301

Spill Date: 2008-12-12

Investigator: smsanges

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104191616 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I100

NAME: NYCDEP BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0505949 / 2005-08-15
ID/Status: 0313238 / 2009-05-01
ID/Status: 0400675 / 2004-04-21
ID/Status: 0810210 / 2008-12-12
ID/Status: 0410975 / 2005-01-11

SOURCE: NY Department of Environmental Conservation

Referred To: Not reported
Reported to Dept: 2008-12-12
CID: Not reported
Water Affected: EAST RIVER
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Not reported
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2008-12-12
Spill Record Last Update: 2008-12-12
Spiller Name: Not reported
Spiller Company: NYCDEP
Spiller Address: Not reported
Spiller Company: 999
Contact Name: DALY
DEC Memo: "heavy rain"
Remarks: "ongoing at this time, unknown discharge volume."

All Materials:
Site ID: 407725
Operable Unit ID: 1164262
Operable Unit: 01
Material ID: 2155636
Material Code: 1877A
Material Name: waste liquid
Case No.: Not reported
Material FA: Other
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Oxygenate: Not reported

Name: BRONX GRID CHAMBER
Address: 158 BRUCKNER BLVD
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 0410975 / 2005-01-11
Facility ID: 0410975
Facility Type: ER
DER Facility ID: 118523
Site ID: 336078

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104191616 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I100

NAME: NYCDEP BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0505949 / 2005-08-15
ID/Status: 0313238 / 2009-05-01
ID/Status: 0400675 / 2004-04-21
ID/Status: 0810210 / 2008-12-12
ID/Status: 0410975 / 2005-01-11

SOURCE: NY Department of Environmental Conservation

DEC Region: 2
Spill Cause: Other
Spill Class: D4
SWIS: 0301
Spill Date: 2005-01-08
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 2005-01-08
CID: 38
Water Affected: EAST RIVER
Spill Source: Major Facility (MOSF) > 400,000 gal
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2005-01-10
Spill Record Last Update: 2005-01-11
Spiller Name: DALY,JAMES
Spiller Company: BRONX GRID CHAMBER
Spiller Address: 158 BRUCKMER AVE.
Spiller Company: 001
Contact Name: DALY,JAMES
DEC Memo: ""
Remarks: "overflow due to rain. Facility unable to handle twice the dry weather flow."

All Materials:
Site ID: 336078
Operable Unit ID: 1098126
Operable Unit: 01
Material ID: 578296
Material Code: 0062A
Material Name: raw sewage
Case No.: Not reported
Material FA: Other
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: BRONX GRIT CHAMBER

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104191616 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I100

NAME: NYCDEP BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0505949 / 2005-08-15
ID/Status: 0313238 / 2009-05-01
ID/Status: 0400675 / 2004-04-21
ID/Status: 0810210 / 2008-12-12
ID/Status: 0410975 / 2005-01-11

SOURCE: NY Department of Environmental Conservation

Address: 158 BRUCKNER BLVD
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 0500342 / 2005-04-08
Facility ID: 0500342
Facility Type: ER
DER Facility ID: 118523
Site ID: 343285
DEC Region: 2
Spill Cause: Equipment Failure
Spill Class: D4
SWIS: 0301
Spill Date: 2005-04-07
Investigator: MXTIPPLE
Referred To: Not reported
Reported to Dept: 2005-04-08
CID: 74
Water Affected: EAST RIVER
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2005-04-08
Spill Record Last Update: 2005-04-08
Spiller Name: HAROLD GRIMES
Spiller Company: BRONX GRIT CHAMBER
Spiller Address: 158 BRUCKNER BLVD
Spiller Company: 001
Contact Name: HAROLD GRIMES
DEC Memo: "4/8/04 Tipple referred site to water unit/nfa"
Remarks: "Causing the plant to not pump 2 times dry weather pump"

All Materials:
Site ID: 343285
Operable Unit ID: 1101969
Operable Unit: 01
Material ID: 582204
Material Code: 0062A
Material Name: raw sewage
Case No.: Not reported
Material FA: Other
Quantity: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104191616	DIST/DIR: 0.069 East	ELEVATION: 18	MAP ID: I100

NAME: NYCDEP BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0505949 / 2005-08-15
ID/Status: 0313238 / 2009-05-01
ID/Status: 0400675 / 2004-04-21
ID/Status: 0810210 / 2008-12-12
ID/Status: 0410975 / 2005-01-11

SOURCE: NY Department of Environmental Conservation

Units: G
Recovered: .00
Oxygenate: Not reported

Name: BRONX GRIT CHAMBER DEP -DDC
Address: 158 BRUCKNER BLVD
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 9605740 / 2002-12-20
Facility ID: 9605740
Facility Type: ER
DER Facility ID: 118523
Site ID: 280282
DEC Region: 2
Spill Cause: Other
Spill Class: D4
SWIS: 0301
Spill Date: 1996-08-03
Investigator: JAKOLLEE
Referred To: Not reported
Reported to Dept: 1996-08-03
CID: 257
Water Affected: EAST RIVER
Spill Source: Commercial/Industrial
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1996-08-03
Spill Record Last Update: 2005-02-03
Spiller Name: JOE ALBRECHT
Spiller Company: NYC DEP
Spiller Address: FOOT OF BRONCKNER BLVD
Spiller Company: 001
Contact Name: JOE ALBRECHT
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
KOLLEENY "
Remarks: "con ed lost power causing spill "
All Materials:
Site ID: 280282
Operable Unit ID: 1036543

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104191616 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I100

NAME: NYCDEP BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0505949 / 2005-08-15
ID/Status: 0313238 / 2009-05-01
ID/Status: 0400675 / 2004-04-21
ID/Status: 0810210 / 2008-12-12
ID/Status: 0410975 / 2005-01-11

SOURCE: NY Department of Environmental Conservation

Operable Unit: 01
Material ID: 348484
Material Code: 0062A
Material Name: raw sewage
Case No.: Not reported
Material FA: Other
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: 158 BRUCKNER BLVD.
Address: 158 BRUCKNER BLVD.
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 9304503 / 1995-08-07
Facility ID: 9304503
Facility Type: ER
DER Facility ID: 113698
Site ID: 131969
DEC Region: 2
Spill Cause: Unknown
Spill Class: D4
SWIS: 0301
Spill Date: 1993-07-09
Investigator: FIFOLT
Referred To: Not reported
Reported to Dept: 1993-07-09
CID: Not reported
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Other
Cleanup Ceased: 1995-08-07
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1994-05-25
Spill Record Last Update: 1995-08-07
Spiller Name: Not reported
Spiller Company: NYC DEP
Spiller Address: Not reported
Spiller Company: 001
Contact Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S104191616	DIST/DIR:	0.069 East	ELEVATION:	18	MAP ID:	I100

NAME: NYCDEP BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 0505949 / 2005-08-15
ID/Status: 0313238 / 2009-05-01
ID/Status: 0400675 / 2004-04-21
ID/Status: 0810210 / 2008-12-12
ID/Status: 0410975 / 2005-01-11

SOURCE: NY Department of Environmental Conservation

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
FILFORT "

Remarks: "SEWAGE BYPASS - REFER TO SPDES."

All Materials:

Site ID: 131969

Operable Unit ID: 982868

Operable Unit: 01

Material ID: 397999

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: -1.00

Units: Not reported

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S104191616 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I100

NAME: NYCDEP BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 9905318 / 2009-05-01
ID/Status: 138623
ID/Status: 1999-08-03

SOURCE: NY Department of Environmental Conservation

LTANKS:

Name: WARDS ISLAND WPCP
Address: 158 BRUCKNER BLVD
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 9905318 / 2009-05-01
Facility ID: 9905318
Site ID: 138623
Spill Date: 1999-08-03
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: B3
Cleanup Ceased: Not reported
SWIS: 0301
Investigator: JMKRIMGO
Referred To: Not reported
Reported to Dept: 1999-08-03
CID: 252
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1999-08-03
Spill Record Last Update: 2009-05-01
Spiller Name: TOM AMESSE
Spiller Company: BRONX SEWAGE TREATMENT
Spiller Address: 158 BRUCKNER BLVD
Spiller County: 001
Spiller Contact: TOM AMESSE
Spiller Phone: (212) 860-9319
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 118523
DEC Memo: "5/1/09. Duplicated with 0313238. JK. "
Remarks: "WILL EXCAVATE TOP OF TANK AND RE-TEST"

All TTF:

Facility ID: 9905318
Spill Number: 9905318
Spill Tank Test: 1547443
Site ID: 138623
Tank Number: FAIL
Tank Size: 7500

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S104191616 **DIST/DIR:** 0.069 East **ELEVATION:** 18 **MAP ID:** I100

NAME: NYCDEP BRONX GRIT CHAMBER

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 9905318 / 2009-05-01
ID/Status: 138623
ID/Status: 1999-08-03

SOURCE: NY Department of Environmental Conservation

Material: 0001
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 14
Test Method 2: VacuTest
Leak Rate: .00
Gross Fail: F
Modified By: Spills
Last Modified Date: Not reported

All Materials:
Site ID: 138623
Operable Unit ID: 1083911
Operable Unit: 01
Material ID: 301618
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1017777142 **DIST/DIR:** 0.074 NE **ELEVATION:** 18 **MAP ID:** M101

NAME: CON EDISON SERVICE BOX: 6163

Rev: 09/13/2021

ADDRESS: 536 E 134TH ST
BRONX, NY 10454
BRONX

ID/Status: NYP004550299

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20140702

Handler Name: CON EDISON SERVICE BOX: 6163

Handler Address: 536 E 134TH ST

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004550299

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: SENIOR SCIENTIST

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL, 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1017777142 **DIST/DIR:** 0.074 NE **ELEVATION:** 18 **MAP ID:** M101

NAME: CON EDISON SERVICE BOX: 6163

Rev: 09/13/2021

ADDRESS: 536 E 134TH ST
BRONX, NY 10454
BRONX

ID/Status: NYP004550299

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDs Where RCRA CA has Been Imposed Universe: No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSD Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150211
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20140602
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1017777142 **DIST/DIR:** 0.074 NE **ELEVATION:** 18 **MAP ID:** M101

NAME: CON EDISON SERVICE BOX: 6163

Rev: 09/13/2021

ADDRESS: 536 E 134TH ST
BRONX, NY 10454
BRONX

ID/Status: NYP004550299

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20140602
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20140702
Handler Name: CON EDISON SERVICE BOX: 6163
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1017777142 **DIST/DIR:** 0.074 NE **ELEVATION:** 18 **MAP ID:** M101

NAME: CON EDISON SERVICE BOX: 6163

Rev: 09/13/2021

ADDRESS: 536 E 134TH ST
BRONX, NY 10454
BRONX

ID/Status: NYP004550299

SOURCE: US Environmental Protection Agency

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104653008 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J102

NAME: MANHOLE 21981

Rev: 08/09/2021

ADDRESS: BROWN PL/BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 0002251 / 2004-03-24

ID/Status: 237886

ID/Status: 2000-05-23

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 21981

Address: BROWN PL/BRUCKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0002251 / 2004-03-24

Facility ID: 0002251

Facility Type: ER

DER Facility ID: 195931

Site ID: 237886

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2000-05-23

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 2000-05-23

CID: 371

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2000-05-23

Spill Record Last Update: 2004-03-24

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: Not reported

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was O'CONNELL e2mis no. 131539: 1 QUART OF UNKNOWN OIL IN 20 GALLONS OF WATER IN MANHOLE # 21981. CONDUIT PLATE 4-C-4 INDICATES A DRAIN CONNECTION. SAMPLE TAKEN CLEAN UP PENDING RESULTS. Sample ID no. 125937 1 ppm 5/24/00 John Maloney reports 2 gallons oil water mix was removed from sump pit. Hole was double washed and flushed. Tag was removed. No sewer connection, sump sealed."

Remarks: "found 1 qt on 20 gals water - sample taken - clean up pending results -- con ed 131539."

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104653008 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J102

NAME: MANHOLE 21981

Rev: 08/09/2021

ADDRESS: BROWN PL/BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 0002251 / 2004-03-24
ID/Status: 237886
ID/Status: 2000-05-23

SOURCE: NY Department of Environmental Conservation

All Materials:

Site ID: 237886

Operable Unit ID: 824173

Operable Unit: 01

Material ID: 550619

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104790290 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J103

NAME: MANHOLE 1249

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/BROWN PL
BRONX, NY
BRONX

ID/Status: 0007932 / 2001-12-14

ID/Status: 104560

ID/Status: 2000-10-05

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 1249

Address: BRUCKNER BLVD/BROWN PL

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0007932 / 2001-12-14

Facility ID: 0007932

Facility Type: ER

DER Facility ID: 92362

Site ID: 104560

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2000-10-05

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 2000-10-05

CID: 312

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2000-10-05

Spill Record Last Update: 2001-12-14

Spiller Name: Not reported

Spiller Company: Not reported

Spiller Address: Not reported

Spiller Company: 001

Contact Name: Not reported

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL Con Ed e2mis #133804 Notes: 10-5-00 1 pint unknown oil on

30gal water in manhole. Manhole 1249 is tied into manhole 1250 which

has a sewer connection. Manhole 1250 is clear and has no evidence of

oil. Sewer does not appear to be affected. PCB sample taken. Sample

returned <1ppm PCBs. 10-10-00 Cleanup completed by double washing

with slix. Liquids removed by tanker, solids by vactor. No leaking

company equipment. "

Remarks: "1 pint unk oil on 30gal of water - contained - case #133804"

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104790290 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J103

NAME: MANHOLE 1249

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/BROWN PL
BRONX, NY
BRONX

ID/Status: 0007932 / 2001-12-14
ID/Status: 104560
ID/Status: 2000-10-05

SOURCE: NY Department of Environmental Conservation

All Materials:

Site ID: 104560

Operable Unit ID: 828560

Operable Unit: 01

Material ID: 545451

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104510945 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J104

NAME: TM694 **Rev:** 08/09/2021
ADDRESS: BROWN PL / BRUCKNER BLVD ID/Status: 9914262 / 2002-03-26
BRONX, NY ID/Status: 131745
BRONX ID/Status: 2000-03-17
SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: TM694
Address: BROWN PL / BRUCKNER BLVD
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 9914262 / 2002-03-26
Facility ID: 9914262
Facility Type: ER
DER Facility ID: 113509
Site ID: 131745
DEC Region: 2
Spill Cause: Unknown
Spill Class: C4
SWIS: 0301
Spill Date: 2000-03-17
Investigator: JHOCONNE
Referred To: Not reported
Reported to Dept: 2000-03-17
CID: 312
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2000-03-17
Spill Record Last Update: 2002-03-26
Spiller Name: Not reported
Spiller Company: CON EDISON
Spiller Address: 4 IRVING PLACE
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
O'CONNELL "
Remarks: "1000GAL OF WATER - CONTAINED - CASE #130450"
All Materials:
Site ID: 131745
Operable Unit ID: 1088788
Operable Unit: 01
Material ID: 292544
Material Code: 0066A
Material Name: unknown petroleum

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S104510945	DIST/DIR:	0.076 NW	ELEVATION:	22	MAP ID:	J104

NAME:	TM694	Rev:	08/09/2021
ADDRESS:	BROWN PL / BRUCKNER BLVD	ID/Status:	9914262 / 2002-03-26
	BRONX, NY	ID/Status:	131745
	BRONX	ID/Status:	2000-03-17
SOURCE:	NY Department of Environmental Conservation		

Case No.: Not reported
Material FA: Petroleum
Quantity: 5.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S105236517 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J105

NAME: MH 21981

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/BROWN PL
BRONX, NY
BRONX

ID/Status: 0108978 / 2004-09-10

ID/Status: 104561

ID/Status: 2001-12-10

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MH 21981

Address: BRUCKNER BLVD/BROWN PL

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0108978 / 2004-09-10

Facility ID: 0108978

Facility Type: ER

DER Facility ID: 92362

Site ID: 104561

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 2001-12-10

Investigator: AERODRIG

Referred To: Not reported

Reported to Dept: 2001-12-10

CID: 396

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2001-12-10

Spill Record Last Update: 2004-09-10

Spiller Name: Not reported

Spiller Company: CON EDISON

Spiller Address: 4 IRVING PLACE

Spiller Company: 001

Contact Name: BILL MURPHY

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was RODRIGUEZ e2mis 140537 10-Dec.-2001 @ 10:18 Hrs. Quality Assurance

Mechanic 'A' Joe Graci, #42890 reports approximately 1 quart dielectric fluid leaked from cable joint onto 3M cable joint below soaking into the arc proof. No fluid leaked onto the floor. Mr. Graci wrapped the leaking joint and installed environmental tag #20547. The feeder involved is 2X23 and is scheduled for replacement.

14-December-2001 21:00 Hrs Operating SUpervisor Larry Fischer #55784 reports while inspecting the manhole on 12/14/01 finding conditions normal, and environmental tag was removed. 03-May-2003 22:26 As per

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S105236517 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J105

NAME: MH 21981

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD/BROWN PL
BRONX, NY
BRONX

ID/Status: 0108978 / 2004-09-10

ID/Status: 104561

ID/Status: 2001-12-10

SOURCE: NY Department of Environmental Conservation

FCR Scully 19919, the Fdr was repaired on 12/20/01."
Remarks: "1 quart spill. clean up pending replacing failed equipt. ref #
140537. oil leaked from failed cabel joint and soaked into wrapping
material on second cabel joint."

All Materials:

Site ID: 104561

Operable Unit ID: 846363

Operable Unit: 01

Material ID: 530185

Material Code: 0541A

Material Name: dielectric fluid

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106720844 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J106

NAME: MANHOLE #21937

Rev: 08/09/2021

ADDRESS: BUCKNER BLVD&BROWN PLACE
BRONX, NY
BRONX

ID/Status: 0409507 / 2005-12-27

ID/Status: 334260

ID/Status: 2004-11-23

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE #21937

Address: BUCKNER BLVD&BROWN PLACE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0409507 / 2005-12-27

Facility ID: 0409507

Facility Type: ER

DER Facility ID: 269452

Site ID: 334260

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 2004-11-23

Investigator: SKARAKHA

Referred To: Not reported

Reported to Dept: 2004-11-23

CID: 407

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2004-11-23

Spill Record Last Update: 2005-12-27

Spiller Name: ERT DESK

Spiller Company: Con Ed

Spiller Address: Not reported

Spiller Company: 001

Contact Name: ERT DESK

DEC Memo: "e2mis no. 156355: 23-Nov-2004 15:27 Snr Eng Tech 42890 reports while inspecting MH-21937 discovered 2 quarts of cable oil on concrete and 1 gallon of water. No sewers, waterways, or private property affected. Env tag 43176 was placed as well a D-Fault tag. A pcb sample was taken on DD15218 and cleanup is pending feeder id. The hole will require flaggers due to the high volume of traffic.

24-Nov-2004 12:15 hrs Lab Sequence Number: 04-09742-001 TOTAL PCB 46

ppm 1-Feb-2005 04:15hrs. Env. A-Mechanic J. Maloney reports partial cleanup from top performed on structure. FOD on location and did not get TC through cable. Fault is alternate leg and will need to have TC

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106720844 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J106

NAME: MANHOLE #21937

Rev: 08/09/2021

ADDRESS: BUCKNER BLVD&BROWN PLACE
BRONX, NY
BRONX

ID/Status: 0409507 / 2005-12-27

ID/Status: 334260

ID/Status: 2004-11-23

SOURCE: NY Department of Environmental Conservation

taken off from station and re-applied. Do to manhattan working on 'L' leg, no TC will be placed on 'M' leg until manhattan work completed. All worked stopped at location. Env. tag will remain in place. Structure has a long chimney and a full cleanup can not be done from the top of the structure. Once FOD can identify the 'D' fault and confirm feeder out of service, env. crews will perform a complete cleanup from inside the structure. Env. A-Mech. J. Maloney reports CFS tanker took on 50 gallons of liqued for transport and disposal at the Astoria WWTF. Vactor did not take on any flush debris. 02-Feb-2005 04:08hrs. Env. A-Mechanic D. Rodriguez reports cleanup complete. Structure previously marked on day shift for 'D' fault on dead feeder 3M60, FOD temporarily sealed leaking joints on abandoned cable. 'C' fault on feeder 3M58 tagged and out of service for 3M joint replacement- note Manhattan will be working 15 locations on this feeder in conjunction with our work. Structure was double washed and rinsed using biogen 760 soap. CFS tanker took on 50 gallons of liqued for transport and disposal at Astoria WWTF. Env. vactor took on 150 lbs. of flush debris for transport and temporary storage at Hellgate TSF. Env. tag 43176 pulled from structure. 'D' fault tag will be removed from structure once U/G splicers permanently cut out abandoned joints and re-seal dead 3M60 feeder. 08-Mar-2005 11:18hrs (update) All work completed on 2-4-2005, 3M snaps removed and I-splices made (rapid Restore) and 'D' fault tag removed. Location taken off C&D Fault list."

Remarks: "Amount 2 quarts with 1 gallon of water. spill cannot be cleaned up within 24 hour period, coned # 156355"

All Materials:

Site ID: 334260

Operable Unit ID: 1096402

Operable Unit: 01

Material ID: 576279

Material Code: 0020B

Material Name: cable oil

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104652960 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J107

NAME: TM 694 **Rev:** 08/09/2021
ADDRESS: BROWN PLACE/BRUCKNER BLVD
BRONX, NY ID/Status: 0002175 / 2004-03-24
BRONX ID/Status: 290661
ID/Status: 2000-05-21
SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: TM 694
Address: BROWN PLACE/BRUCKNER BLVD
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 0002175 / 2004-03-24
Facility ID: 0002175
Facility Type: ER
DER Facility ID: 235354
Site ID: 290661
DEC Region: 2
Spill Cause: Unknown
Spill Class: C4
SWIS: 0301
Spill Date: 2000-05-21
Investigator: JHOCONNE
Referred To: Not reported
Reported to Dept: 2000-05-21
CID: 382
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2000-05-21
Spill Record Last Update: 2004-03-24
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller Company: 999
Contact Name: TED ROBICHARD
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
O'CONNELL e2mis no. 131514 4 gallons unknown oil on 2000 gallons
water in TM 694. Sample taken. Lab Sequence Number: 00-05018 ANALYSIS
INDICATES THE PRESENCE OF A SUBSTANCE SIMILAR TO A LIGHT FUEL OIL.
Lab Sequence Number: 00-05017 PCB <1 ppm 5/23/00 MECHANIC REPORTS HE
REMOVED 5000 GALLONS OF WATER AND DOUBLE WASHED MANHOLE."
Remarks: "con ed 131-514. unknown oil on 2000 gals of water contained in
manhole. clean up pending."

All Materials:
Site ID: 290661

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104652960 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J107

NAME: TM 694 **Rev:** 08/09/2021
ADDRESS: BROWN PLACE/BRUCKNER BLVD ID/Status: 0002175 / 2004-03-24
BRONX, NY ID/Status: 290661
BRONX ID/Status: 2000-05-21
SOURCE: NY Department of Environmental Conservation

Operable Unit ID: 824083
Operable Unit: 01
Material ID: 550545
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: 4.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S106736401 **DIST/DIR:** 0.076 ESE **ELEVATION:** 18 **MAP ID:** I108

NAME: BRONX GRID CHAMBER

Rev: 08/09/2021

ADDRESS: 158 BRUCKMER AVE.

ID/Status: 0410584 / 2004-12-24

BRONX, NY

ID/Status: 335597

BRONX

ID/Status: 2004-12-23

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: BRONX GRID CHAMBER

Address: 158 BRUCKMER AVE.

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0410584 / 2004-12-24

Facility ID: 0410584

Facility Type: ER

DER Facility ID: 270841

Site ID: 335597

DEC Region: 2

Spill Cause: Other

Spill Class: C4

SWIS: 0301

Spill Date: 2004-12-23

Investigator: MXTIPPLE

Referred To: Not reported

Reported to Dept: 2004-12-23

CID: 408

Water Affected: EAST RIVER

Spill Source: Commercial/Industrial

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2004-12-23

Spill Record Last Update: 2004-12-24

Spiller Name: DALY,JAMES

Spiller Company: BRONX GRID CHAMBER

Spiller Address: 158 BRUCKMER AVE.

Spiller Company: 001

Contact Name: DALY,JAMES

DEC Memo: "referred to water"

Remarks: "DUE TO HEAVY RAIN :"

All Materials:

Site ID: 335597

Operable Unit ID: 1097657

Operable Unit: 01

Material ID: 577683

Material Code: 0062A

Material Name: raw sewage

Case No.: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S106736401	DIST/DIR:	0.076 ESE	ELEVATION:	18	MAP ID:	I108

NAME: BRONX GRID CHAMBER

Rev: 08/09/2021

ADDRESS: 158 BRUCKMER AVE.

ID/Status: 0410584 / 2004-12-24

BRONX, NY

ID/Status: 335597

BRONX

ID/Status: 2004-12-23

SOURCE: NY Department of Environmental Conservation

Material FA: Other

Quantity: Not reported

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S110306559 **DIST/DIR:** 0.076 ESE **ELEVATION:** 18 **MAP ID:** I109

NAME: 213560; 150 BRUCKNER BLVD

Rev: 08/09/2021

ADDRESS: 150 BRUCKNER BLVD

ID/Status: 0814452 / 2008-10-19

NEW YORK, NY

ID/Status: 0814456 / 2008-09-20

BRONX

ID/Status: 432723

SOURCE: NY Department of Environmental Conservation

ID/Status: 432385

ID/Status: 2008-09-10

SPILLS:

Name: 213560; 150 BRUCKNER BLVD

Address: 150 BRUCKNER BLVD

City,State,Zip: NEW YORK, NY

Spill Number/Closed Date: 0814452 / 2008-10-19

Facility ID: 0814452

Facility Type: ER

DER Facility ID: 386321

Site ID: 432723

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: D4

SWIS: 0301

Spill Date: 2008-09-10

Investigator: DMPOKRZY

Referred To: Not reported

Reported to Dept: 2008-12-31

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: Not reported

Last Inspection: Not reported

Recommended Penalty: Not reported

UST Trust: Not reported

Remediation Phase: 0

Date Entered In Computer: 2010-04-16

Spill Record Last Update: 2010-04-16

Spiller Name: ERT DESK

Spiller Company: CON EDISON

Spiller Address: 5030 BROADWAY

Spiller Company: 001

Contact Name: ERT DESK

DEC Memo: ""

Remarks: ""

All Materials:

Site ID: 432723

Operable Unit ID: 1183784

Operable Unit: 01

Material ID: 2177972

Material Code: 0541A

Material Name: dielectric fluid

Case No.: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S110306559 **DIST/DIR:** 0.076 ESE **ELEVATION:** 18 **MAP ID:** I109

NAME: 213560; 150 BRUCKNER BLVD

Rev: 08/09/2021

ADDRESS: 150 BRUCKNER BLVD
NEW YORK, NY
BRONX

ID/Status: 0814452 / 2008-10-19

ID/Status: 0814456 / 2008-09-20

ID/Status: 432723

ID/Status: 432385

ID/Status: 2008-09-10

SOURCE: NY Department of Environmental Conservation

Material FA: Petroleum

Quantity: 5.00

Units: G

Recovered: Not reported

Oxygenate: Not reported

Name: 213603; 150 BRUCKNER BLVD

Address: 150 BRUCKNER BLVD

City,State,Zip: NEW YORK, NY

Spill Number/Closed Date: 0814456 / 2008-09-20

Facility ID: 0814456

Facility Type: ER

DER Facility ID: 386320

Site ID: 432385

DEC Region: 2

Spill Cause: Unknown

Spill Class: D4

SWIS: 0301

Spill Date: 2008-09-11

Investigator: DMPOKRZY

Referred To: Not reported

Reported to Dept: 2008-12-31

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: Not reported

Last Inspection: Not reported

Recommended Penalty: Not reported

UST Trust: Not reported

Remediation Phase: 0

Date Entered In Computer: 2010-04-16

Spill Record Last Update: 2010-04-16

Spiller Name: ERT DESK

Spiller Company: CON EDISON

Spiller Address: 5030 BROADWAY

Spiller Company: 001

Contact Name: ERT DESK

DEC Memo: ""

Remarks: ""

All Materials:

Site ID: 432385

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S110306559	DIST/DIR:	0.076 ESE	ELEVATION:	18	MAP ID:	I109

NAME: 213560; 150 BRUCKNER BLVD

Rev: 08/09/2021

ADDRESS: 150 BRUCKNER BLVD
NEW YORK, NY
BRONX

ID/Status: 0814452 / 2008-10-19

ID/Status: 0814456 / 2008-09-20

ID/Status: 432723

ID/Status: 432385

SOURCE: NY Department of Environmental Conservation

ID/Status: 2008-09-10

Operable Unit ID: 1183446

Operable Unit: 01

Material ID: 2177634

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: Not reported

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010326228 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J110

NAME: CON EDISON MANHOLE 1250

Rev: 09/13/2021

ADDRESS: BROWN PL & BRUCKNER BLVD
BRONX, NY 10451
BRONX

ID/Status: NYP004140091

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20060707

Handler Name: CON EDISON MANHOLE 1250

Handler Address: BROWN PL & BRUCKNER BLVD

Handler City,State,Zip: BRONX, NY 10451

EPA ID: NYP004140091

Contact Name: STEVEN MARTIS

Contact Address: 4 IRVING PL, RM 828

Contact City,State,Zip: NEW YORK, NY 10003

Contact Telephone: 212-580-8383

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Not reported

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: 4 IRVING PL, RM 828

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010326228 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J110

NAME: CON EDISON MANHOLE 1250

Rev: 09/13/2021

ADDRESS: BROWN PL & BRUCKNER BLVD
BRONX, NY 10451
BRONX

ID/Status: NYP004140091

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20060705
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010326228 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J110

NAME: CON EDISON MANHOLE 1250

Rev: 09/13/2021

ADDRESS: BROWN PL & BRUCKNER BLVD
BRONX, NY 10451
BRONX

ID/Status: NYP004140091

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Not reported
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060706
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060707
Handler Name: CON EDISON MANHOLE 1250
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010326228 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J110

NAME: CON EDISON MANHOLE 1250

Rev: 09/13/2021

ADDRESS: BROWN PL & BRUCKNER BLVD
BRONX, NY 10451
BRONX

ID/Status: NYP004140091

SOURCE: US Environmental Protection Agency

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1017775371 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J111

NAME: CON EDISON MANHOLE: 21981

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROWN PL
BRONX, NY 10457
BRONX

ID/Status: NYP004532032

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20140614

Handler Name: CON EDISON MANHOLE: 21981

Handler Address: BRUCKNER BLVD & BROWN PL

Handler City,State,Zip: BRONX, NY 10457

EPA ID: NYP004532032

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: SENIOR SCIENTIST

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL, 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1017775371 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J111

NAME: CON EDISON MANHOLE: 21981

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROWN PL
BRONX, NY 10457
BRONX

ID/Status: NYP004532032

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDs Where RCRA CA has Been Imposed Universe: No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSD Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150211
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20140514
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1017775371 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J111

NAME: CON EDISON MANHOLE: 21981

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROWN PL
BRONX, NY 10457
BRONX

ID/Status: NYP004532032

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20140514
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20140614
Handler Name: CON EDISON MANHOLE: 21981
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1017775371 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J111

NAME: CON EDISON MANHOLE: 21981

Rev: 09/13/2021

ADDRESS: BRUCKNER BLVD & BROWN PL
BRONX, NY 10457
BRONX

ID/Status: NYP004532032

SOURCE: US Environmental Protection Agency

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1016973918 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J112

NAME: CON EDISON MANHOLE: 21983

Rev: 09/13/2021

ADDRESS: BROWN PL & BRUCKNER BLVD
BRONX, NY 10451
BRONX

ID/Status: NYP004477261

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20140424

Handler Name: CON EDISON MANHOLE: 21983

Handler Address: BROWN PL & BRUCKNER BLVD

Handler City,State,Zip: BRONX, NY 10451

EPA ID: NYP004477261

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: SENIOR SCIENTIST

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL, 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1016973918	DIST/DIR: 0.076 NW	ELEVATION: 22	MAP ID: J112

NAME: CON EDISON MANHOLE: 21983

Rev: 09/13/2021

ADDRESS: BROWN PL & BRUCKNER BLVD
BRONX, NY 10451
BRONX

ID/Status: NYP004477261

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20141014
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20140324
Handler Name: CON EDISON MANHOLE: 21983

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1016973918 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J112

NAME: CON EDISON MANHOLE: 21983

Rev: 09/13/2021

ADDRESS: BROWN PL & BRUCKNER BLVD
BRONX, NY 10451
BRONX

ID/Status: NYP004477261

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: No

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

Receive Date: 20140424

Handler Name: CON EDISON MANHOLE: 21983

Federal Waste Generator Description: Not a generator, verified

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: Yes

Non Storage Recycler Activity: Not reported

Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S110307383 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J113

NAME: 218329; BRUCKNER BLVD. AND BROWN PLACE

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD. AND BROWN PLACE
BRONX, NY
BRONX

ID/Status: 0914447 / 2009-09-06

ID/Status: 433861

ID/Status: 2009-09-05

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: 218329; BRUCKNER BLVD. AND BROWN PLACE

Address: BRUCKNER BLVD. AND BROWN PLACE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0914447 / 2009-09-06

Facility ID: 0914447

Facility Type: ER

DER Facility ID: 388740

Site ID: 433861

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: D4

SWIS: 0301

Spill Date: 2009-09-05

Investigator: DMPOKRZY

Referred To: Not reported

Reported to Dept: 2009-12-31

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: Not reported

Last Inspection: Not reported

Recommended Penalty: Not reported

UST Trust: Not reported

Remediation Phase: 0

Date Entered In Computer: 2010-04-27

Spill Record Last Update: 2010-04-27

Spiller Name: ERT DESK

Spiller Company: CON EDISON

Spiller Address: 5030 BROADWAY

Spiller Company: 001

Contact Name: ERT DESK

DEC Memo: ""

Remarks: ""

All Materials:

Site ID: 433861

Operable Unit ID: 1184710

Operable Unit: 01

Material ID: 2179157

Material Code: 0541A

Material Name: dielectric fluid

Case No.: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S110307383	DIST/DIR:	0.076 NW	ELEVATION:	22	MAP ID:	J113

NAME: 218329; BRUCKNER BLVD. AND BROWN PLACE

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD. AND BROWN PLACE
BRONX, NY
BRONX

ID/Status: 0914447 / 2009-09-06

ID/Status: 433861

ID/Status: 2009-09-05

SOURCE: NY Department of Environmental Conservation

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: Not reported

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S107416613	DIST/DIR: 0.076 NW	ELEVATION: 22	MAP ID: J114

NAME: MANHOLE #1249

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD & BROWN PLACE
BRONX, NY
BRONX

ID/Status: 0509280 / 2005-12-16

ID/Status: 355036

ID/Status: 2005-11-02

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE #1249

Address: BRUCKNER BLVD & BROWN PLACE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0509280 / 2005-12-16

Facility ID: 0509280

Facility Type: ER

DER Facility ID: 305037

Site ID: 355036

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 2005-11-02

Investigator: GDBREEN

Referred To: Not reported

Reported to Dept: 2005-11-02

CID: 444

Water Affected: Not reported

Spill Source: Institutional, Educational, Gov., Other

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2005-11-02

Spill Record Last Update: 2005-12-16

Spiller Name: ERT DESK

Spiller Company: CON EDISON

Spiller Address: BRUCKNER/BROWN PLACE

Spiller Company: 001

Contact Name: ERT DESK

DEC Memo: "161770. 02-Nov-2005 14:00 hrs. Spicer, Andre Wise (20145) while inspecting MH-1249 located at SWC Bruckner Blvd & Brown Place, Bronx, NY reports finding ~ 5 oz cable oil from leaky primary cable possibly under 1500 gallons of water. Manhole has been d-faulted (#07176). No fire/smoke is/was involved. No sewers, waterways or private property were affected. No injuries were reported at this time. Crew hung environmental tag # 49884 in structure. Crew took a sample for PCB on chain of custody (ee-11392). Parking Restrictions are: SURE ACCESS-WESTERLY- MANHOLE. Clean up pending de-energization of feeders and sample results. L Fischer 55784. Closed. 12-16-05. see eDocs. GB "

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S107416613 **DIST/DIR:** 0.076 NW **ELEVATION:** 22 **MAP ID:** J114

NAME: MANHOLE #1249

Rev: 08/09/2021

ADDRESS: BRUCKNER BLVD & BROWN PLACE
BRONX, NY
BRONX

ID/Status: 0509280 / 2005-12-16
ID/Status: 355036
ID/Status: 2005-11-02

SOURCE: NY Department of Environmental Conservation

Not reported

Remarks: "5 OUNCES ON 1500 GALLONS OF WATER: NO TO 5QUESTIONS; CONED #161770"

All Materials:

Site ID: 355036

Operable Unit ID: 1112407

Operable Unit: 01

Material ID: 2102452

Material Code: 0020B

Material Name: cable oil

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S102961954 **DIST/DIR:** 0.077 North **ELEVATION:** 18 **MAP ID:** N115

NAME: SIDEWALK INFRONT OF

Rev: 08/09/2021

ADDRESS: 500 EAST 134TH ST
BRONX, NY
BRONX

ID/Status: 9710619 / 1997-12-17
ID/Status: 71586
ID/Status: 1997-12-17

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: SIDEWALK INFRONT OF

Address: 500 EAST 134TH ST

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9710619 / 1997-12-17

Facility ID: 9710619

Facility Type: ER

DER Facility ID: 67721

Site ID: 71586

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 1997-12-17

Investigator: SMMARTIN

Referred To: Not reported

Reported to Dept: 1997-12-17

CID: 257

Water Affected: Not reported

Spill Source: Private Dwelling

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1997-12-17

Spill Record Last Update: 1997-12-18

Spiller Name: FRANK RIZZO

Spiller Company: CRYSTAL TRANS CORP

Spiller Address: 2010 WHITEPLAINS RD

Spiller Company: 001

Contact Name: FRANK RIZZO

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
MARTINKAT PBS# 2-253456 EXPIRED - TRIED #'S (1) NO ANS, (2) LEFT
MESSAGE."

Remarks: "gauge read is reading wrong cleanup crew on the way to clean driver
has spill contained on sidewalk"

All Materials:

Site ID: 71586

Operable Unit ID: 1056981

Operable Unit: 01

Material ID: 328909

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S102961954 **DIST/DIR:** 0.077 North **ELEVATION:** 18 **MAP ID:** N115

NAME: SIDEWALK INFRONT OF

Rev: 08/09/2021

ADDRESS: 500 EAST 134TH ST
BRONX, NY
BRONX

ID/Status: 9710619 / 1997-12-17
ID/Status: 71586
ID/Status: 1997-12-17

SOURCE: NY Department of Environmental Conservation

Material Code: 0002A
Material Name: #4 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 13.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104651561 **DIST/DIR:** 0.080 ESE **ELEVATION:** 18 **MAP ID:** O116

NAME: MANHOLE #2644

Rev: 08/09/2021

ADDRESS: 150 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 0000158 / 2000-05-12

ID/Status: 0000159 / 2000-04-05

ID/Status: 69628

ID/Status: 69629

SOURCE: NY Department of Environmental Conservation

ID/Status: 2000-04-04

SPILLS:

Name: MANHOLE #2644

Address: 150 BRUCKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0000158 / 2000-05-12

Facility ID: 0000158

Facility Type: ER

DER Facility ID: 66186

Site ID: 69628

DEC Region: 2

Spill Cause: Unknown

Spill Class: C3

SWIS: 0301

Spill Date: 2000-04-04

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 2000-04-04

CID: 201

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2000-04-04

Spill Record Last Update: 2000-05-22

Spiller Name: UNKNOWN

Spiller Company: Unknown

Spiller Address: UNKNOWN

Spiller Company: 999

Contact Name: CALLER

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL CON ED E2 MIS REPORT 4/05/00 100 gals. of oil in vault

#2644 and 100 gals. of oil in vault #2422, vault side by side in

front of Bruckner Blvd. Vault#2130 also at same location is dry.

Conduit plate #3-D-2 shows sewer connection. Mr. Jakubowski was able

to pull feed to sump. Took sample...ERT Mike Kessler on location and

DEP rep on location. EPA ID# NYP 004052767 DEC INSPECTOR NOTES

Apparently one transformer,two interconnected vaults. Had to wait for

deenergization to cleanup. Total capacity of transformer is 285gals.

200gals. pumped out of vault, assumed 85 went down sewer, open sewer

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104651561 **DIST/DIR:** 0.080 ESE **ELEVATION:** 18 **MAP ID:** O116

NAME: MANHOLE #2644

Rev: 08/09/2021

ADDRESS: 150 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 0000158 / 2000-05-12

ID/Status: 0000159 / 2000-04-05

ID/Status: 69628

ID/Status: 69629

SOURCE: NY Department of Environmental Conservation

ID/Status: 2000-04-04

top found oil residue. Final cleanup done 5/09/00"
Remarks: "100 GLS OF UNK OIL - CLEAN UP WILL BEGIN AS 50 TO 490 PPM CON ED
#130747"

All Materials:

Site ID: 69628

Operable Unit ID: 821884

Operable Unit: 01

Material ID: 288422

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 100.00

Units: G

Recovered: .00

Oxygenate: Not reported

Name: MANHOLE #2422

Address: 150 BRUCKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0000159 / 2000-04-05

Facility ID: 0000159

Facility Type: ER

DER Facility ID: 66186

Site ID: 69629

DEC Region: 2

Spill Cause: Unknown

Spill Class: C3

SWIS: 0301

Spill Date: 2000-04-04

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 2000-04-04

CID: 201

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104651561 **DIST/DIR:** 0.080 ESE **ELEVATION:** 18 **MAP ID:** O116

NAME: MANHOLE #2644

Rev: 08/09/2021

ADDRESS: 150 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 0000158 / 2000-05-12

ID/Status: 0000159 / 2000-04-05

ID/Status: 69628

ID/Status: 69629

SOURCE: NY Department of Environmental Conservation

ID/Status: 2000-04-04

Date Entered In Computer: 2000-04-04

Spill Record Last Update: 2000-04-05

Spiller Name: UNKNOWN

Spiller Company: Unknown

Spiller Address: UNKNOWN

Spiller Company: 999

Contact Name: CALLER

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
O'CONNELL Track under spill # 0000158 (same incident)."

Remarks: "100 GLS OF UN OIL - CLEAN UP WILL BEGIN AS 50-499 PPM CON ED #130747"
Not reported

All Materials:

Site ID: 69629

Operable Unit ID: 821886

Operable Unit: 01

Material ID: 288423

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 100.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S104651561 **DIST/DIR:** 0.080 ESE **ELEVATION:** 18 **MAP ID:** O116

NAME: MANHOLE #2644

Rev: 08/09/2021

ADDRESS: 150 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 0112160 / 2003-03-21

ID/Status: 69630

ID/Status: 2002-03-18

SOURCE: NY Department of Environmental Conservation

LTANKS:

Name: AMERICAN BUILDING SUPPLY

Address: 150 BRUCKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0112160 / 2003-03-21

Facility ID: 0112160

Site ID: 69630

Spill Date: 2002-03-18

Spill Cause: Tank Failure

Spill Source: Commercial/Industrial

Spill Class: C3

Cleanup Ceased: Not reported

SWIS: 0301

Investigator: SMSANGES

Referred To: Not reported

Reported to Dept: 2002-03-26

CID: 405

Water Affected: Not reported

Spill Notifier: Responsible Party

Last Inspection: Not reported

Recommended Penalty: False

Meets Standard: False

UST Involvement: True

Remediation Phase: 0

Date Entered In Computer: 2002-03-26

Spill Record Last Update: 2003-03-21

Spiller Name: HOWARD KAHN

Spiller Company: AMERICAN BUILDING SUPPLY

Spiller Address: 150 BRUCKNER BLVD

Spiller County: 001

Spiller Contact: HOWARD KAHN

Spiller Phone: (718) 401-1200

Spiller Extention: Not reported

DEC Region: 2

DER Facility ID: 66186

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was SANGESLAND 3/26/2002-Spill was reported to the DEC for the first time today. Mr. Howard Kahn (718-401-1200 or 212-876-1100) is in the process of buying this building in the Bronx through the IDA (State - City/private financial support company) In Dec 2001, PW Grosser did a Phase II inspection of the property including soil borings and water samples. A report was prepared and forwarded to the property owner, purchaser etc. Petroleum contamination was found, but no report was ever made to the DEC. At some point between Dec 2001 and March 2002,

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S104651561	DIST/DIR: 0.080 ESE	ELEVATION: 18	MAP ID: O116

NAME: MANHOLE #2644

Rev: 08/09/2021

ADDRESS: 150 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 0112160 / 2003-03-21

ID/Status: 69630

ID/Status: 2002-03-18

SOURCE: NY Department of Environmental Conservation

Kevin O'Connor at Action Environmental (516-781-3000 ext 2421) prepared a Remediation Proposal which outlines how the environmental issues can be closed out. As of 3/26/2002 no documents of any sort have been submitted to the DEC for review. Due to a Closing Deadline of 3/28/02, Sangesland has scheduled a meeting at DEC office for 10:30 AM on 3/27/02. Representatives of IDA, the purchaser and Action Environmental will present the results of the Phase II report (prepared by PW Grosser), the Remediation Plan and will discuss the options and expected scope of work required to close the spill out. DEC is looking for: 1) DELINEATION of the site. - No scope of remediation work can be defined until the size of the problem is determined. Since the site is listed as 6- 550 gal gasoline UST's, the DEC will look at this site in scope as an old gasoline service station. A major portion of the scope of work depends on the ground water. Depending upon GW depth and tested quality. 2) REMEDIATION of the site. - Once the site is properly delineated and a reasonable understanding is presented of the size of the problem, a proper Remediation Plan can be presented (Depending on the work done to date, there MAY be enough information to move on to this step). 3) Based on the information discussed today, it sounds like the 6 UST's will be pulled, any visually contaminated soil in the area will be removed and end point samples taken. If there is concern about leaving the holes open, or redigging the site, it may pay to over dig the excavation to begin with. 4) Any impacts to ground water will need to be addressed in some way. Depending on the degree of problem, either a pump & treat system, a biological or some other Active system could be required. 5/6/2002 Kevin O'Connor called to say the 4 tanks near the front garage door area are being removed today. The bottom slab of the tank vault appears clean and will be left in place. The contaminated soil around this location will be removed later this week. Mr. O'Connor stated that they will finish up with this location, and restore it for use before they start work on the two other locations on the property. 6/6/2002 Sangesland spoke to Kevin O'Connor concerning some of the initial test results. Lab results dated May 30, 2002 from Long Island Analytical Laboratories, Inc. show a couple of minor exceedences of SVOC's from the end point samples taken in the South Excavation. Sangesland reviewed these levels. Because of building structural problems (no access) Sangesland gave approval to backfill and cap the area and move on with the job. Kevin O'Connor said he would include all details from all excavations on the site in his final report. 8/15/2002 - Floor drain area in center of building was dug out. 40 yds of soil was disposed - endpoints were clean. Sangesland forwarded a copy of Spill Closure Report outline Mr. O'Connor said he would be finishing up the job and sending in a final report soon. 12/24/2002 - Zhao spoke with

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S104651561 **DIST/DIR:** 0.080 ESE **ELEVATION:** 18 **MAP ID:** O116

NAME: MANHOLE #2644

Rev: 08/09/2021

ADDRESS: 150 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 0112160 / 2003-03-21

ID/Status: 69630

ID/Status: 2002-03-18

SOURCE: NY Department of Environmental Conservation

Brain Davis, American Building Supplies. Based on the review of the closure report dated 12/4/02 and pervious site assessment in Dec 2001, the DEC can not closed out the spill under the current condition. 1) The boring logs and all sample results from 2001 were missing from current report. 2) A minimum of two groundwater samples required at southwest area which have not been performed (the methods could be using geoprobe or monitoring wells). 3) If contanination of groundwater has been addressed in 2001 site assessment report, a minimum of three monitoring well required for remediation. 3/21/2003 Sangesland reviewed a submittal from P.W. Grosser which showed some minor groundwater exceedences. Enough work has been done on this site to justify closure. Spill Closed."

Remarks: "CALLER STATES THAT THERE ARE 6 SMALL UNDERGROUND GASOLINE TANKS THAT HAVE LEAKED INTO THE GROUND - ARE GOING TO REMOVE THE TANKS AND REMEDIATE THE SOIL - BREAKUP SURFACE CONTRETE AND BACK FILL AND SPILL IS NEAR DRAIN LINE"

All Materials:

Site ID: 69630

Operable Unit ID: 849112

Operable Unit: 01

Material ID: 526173

Material Code: 0009

Material Name: gasoline

Case No.: Not reported

Material FA: Petroleum

Quantity: .00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U004045952 **DIST/DIR:** 0.080 ESE **ELEVATION:** 18 **MAP ID:** O117

NAME: AMERICAN BUILDING SUPPLY CORP. **Rev:** 06/21/2021
ADDRESS: 150 BRUCKNER BLVD.
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

UST:

Name: AMERICAN BUILDING SUPPLY CORP.
Address: 150 BRUCKNER BLVD.
City,State,Zip: BRONX, NY 10454
Id/Status: 2-607822 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: N/A
UTM X: 591138.10599
UTM Y: 4517487.32888
Site Type: Unknown

Affiliation Records:

Site Id: 29674
Affiliation Type: Facility Owner
Company Name: DRK LLC
Contact Type: Not reported
Contact Name: Not reported
Address1: 150 BRUCKNER BLVD.
Address2: Not reported
City: BRONX
State: NY
Zip Code: 10454
Country Code: 001
Phone: (718) 401-1200
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 29674

Affiliation Type: Mail Contact
Company Name: AMERICAN BUILDING SUPPLY CORP.
Contact Type: Not reported
Contact Name: HOWARD KAHN
Address1: 150 BRUCKNER BLVD.
Address2: Not reported
City: BRONX
State: NY
Zip Code: 10454
Country Code: 001
Phone: (718) 401-1200
EMail: Not reported
Fax Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U004045952 **DIST/DIR:** 0.080 ESE **ELEVATION:** 18 **MAP ID:** O117

NAME: AMERICAN BUILDING SUPPLY CORP. **Rev:** 06/21/2021
ADDRESS: 150 BRUCKNER BLVD.
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 29674
Affiliation Type: Facility Operator
Company Name: AMERICAN BUILDING SUPPLY CORP.
Contact Type: Not reported
Contact Name: ROBERT RISH
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 401-1200
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 29674
Affiliation Type: Emergency Contact
Company Name: DRK LLC
Contact Type: Not reported
Contact Name: ROBERT RISH
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 401-1200
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 001
Tank ID: 63578
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U004045952 **DIST/DIR:** 0.080 ESE **ELEVATION:** 18 **MAP ID:** O117

NAME: AMERICAN BUILDING SUPPLY CORP. **Rev:** 06/21/2021
ADDRESS: 150 BRUCKNER BLVD.
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Number: 002
Tank ID: 63579
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U004045952 **DIST/DIR:** 0.080 ESE **ELEVATION:** 18 **MAP ID:** O117

NAME: AMERICAN BUILDING SUPPLY CORP.

Rev: 06/21/2021

ADDRESS: 150 BRUCKNER BLVD.
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Last Modified: 04/14/2017

Equipment Records:

B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Number: 003

Tank ID: 63580

Tank Status: Closed - Removed

Material Name: Closed - Removed

Capacity Gallons: 550

Install Date: Not reported

Date Tank Closed: Not reported

Registered: True

Tank Location: Underground

Tank Type: Steel/carbon steel

Material Code: 0000

Common Name of Substance: Empty

Tightness Test Method: NN

Date Test: Not reported

Next Test Date: Not reported

Pipe Model: Not reported

Modified By: TRANSLAT

Last Modified: 04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
F00 - Pipe External Protection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U004045952 **DIST/DIR:** 0.080 ESE **ELEVATION:** 18 **MAP ID:** O117

NAME: AMERICAN BUILDING SUPPLY CORP.

Rev: 06/21/2021

ADDRESS: 150 BRUCKNER BLVD.
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Tank Number: 004
Tank ID: 63581
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Number: 005
Tank ID: 63582
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U004045952 **DIST/DIR:** 0.080 ESE **ELEVATION:** 18 **MAP ID:** O117

NAME: AMERICAN BUILDING SUPPLY CORP. **Rev:** 06/21/2021
ADDRESS: 150 BRUCKNER BLVD.
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Tank Number: 006
Tank ID: 63583
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0000
Common Name of Substance: Empty

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U004045952 **DIST/DIR:** 0.080 ESE **ELEVATION:** 18 **MAP ID:** O117

NAME: AMERICAN BUILDING SUPPLY CORP.

Rev: 06/21/2021

ADDRESS: 150 BRUCKNER BLVD.
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

I00 - Overfill - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S105141036 **DIST/DIR:** 0.083 North **ELEVATION:** 18 **MAP ID:** N118

NAME: BROOK AV

Rev: 08/09/2021

ADDRESS: E134TH ST

ID/Status: 0104552 / 2001-07-31

BRONX, NY

ID/Status: 69555

BRONX

ID/Status: 2001-07-28

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: BROOK AV

Address: E134TH ST

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0104552 / 2001-07-31

Facility ID: 0104552

Facility Type: ER

DER Facility ID: 66121

Site ID: 69555

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2001-07-28

Investigator: MXTIPPLE

Referred To: Not reported

Reported to Dept: 2001-07-28

CID: 323

Water Affected: Not reported

Spill Source: Commercial Vehicle

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2001-07-28

Spill Record Last Update: 2001-07-31

Spiller Name: Not reported

Spiller Company: TRACTOR TRAILER

Spiller Address: UNK

Spiller Company: 001

Contact Name: OPERATOR 817

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

TIPPLE CLEANED BY FDNY"

Remarks: "LEAK FROM SADDLE TANK INTO SEWER. LEAK STOPPED AND CLEANED UP BY
FDNY."

All Materials:

Site ID: 69555

Operable Unit ID: 842942

Operable Unit: 01

Material ID: 568821

Material Code: 0008

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S105141036 **DIST/DIR:** 0.083 North **ELEVATION:** 18 **MAP ID:** N118

NAME: BROOK AV

Rev: 08/09/2021

ADDRESS: E134TH ST
BRONX, NY
BRONX

ID/Status: 0104552 / 2001-07-31
ID/Status: 69555
ID/Status: 2001-07-28

SOURCE: NY Department of Environmental Conservation

Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 5.00
Units: G
Recovered: 5.00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103575239 **DIST/DIR:** 0.083 North **ELEVATION:** 18 **MAP ID:** N119

NAME: MANHOLE #1399

Rev: 08/09/2021

ADDRESS: E 134TH ST/ BROOK AVE
BRONX, NY
BRONX

ID/Status: 9811310 / 2003-02-13

ID/Status: 127589

ID/Status: 1998-12-08

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE #1399

Address: E 134TH ST/ BROOK AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9811310 / 2003-02-13

Facility ID: 9811310

Facility Type: ER

DER Facility ID: 110156

Site ID: 127589

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 1998-12-08

Investigator: CAENGELH

Referred To: Not reported

Reported to Dept: 1998-12-08

CID: 370

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1998-12-08

Spill Record Last Update: 2003-03-12

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: ABOVE CALLER

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was ENGELHARDT E2MIS 121809 MECH. T. CREAMER REPORTS: THAT HE FOUND WATER AND OIL MIX IN MH1399 WHILE PULLING CABLE FOR A FEEDER JOB 3M66. APPROX. 2 GALS. OF WATER AND 1/2 GAL. OF OIL WAS FOUND. THE SPILL IS CONTAINED AND DID NOT ENTER THE ENVIR. OR SEWERS OR WATERWAYS. THE WATER AND OIL IS AT A STEADY LEVEL. ACCORDING TO CONDUIT PLATE 4-C-3 THERE'S A SEWER CONNECTION AT THIS LOCATION. SUPV. J. MCCOY IS ENROUTE TO PLACE A ENVIR. STOP TAG AND TAKE SAMPLES FOR PCB. THE MANHOLE APPEARS TO BE IN GOOD CONDITION NO CRACKS IN THE WALLS. THERE'S PRIMARY AND SECONDARY CABLE WITHIN MH1399. CIG NOTIFIED AT

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103575239 **DIST/DIR:** 0.083 North **ELEVATION:** 18 **MAP ID:** N119

NAME: MANHOLE #1399

Rev: 08/09/2021

ADDRESS: E 134TH ST/ BROOK AVE
BRONX, NY
BRONX

ID/Status: 9811310 / 2003-02-13

ID/Status: 127589

ID/Status: 1998-12-08

SOURCE: NY Department of Environmental Conservation

18:26. TAG #20120 WAS PLACED. 12/10/98 98-13629 RESULTS 1254 AROCLOR
28 PPM -001 SAMPLE TYPE: OIL 1254 28. PPM EQUIPMENT : MANHOLE # 1399
LOCATION : N/E/C E.134TH ST. & BROOK AVE VAULT: N/A FDR: N/A CINDE
ID# : OIL MATRIX: 1MG/L 2MG/L 2MG/L .5MG/L 2MG/L 1MG/L 1MG/L 1MG/L
SOIL MATRIX: 2MG/KG 1MG/KG 2MG/KG WIPE MATRIX: 1UG/100CM2 1UG/100CM2
1UG/100CM2 PPB = UG/L; PPM = MG/L, MG/KG; MDL = METHOD DETECTION
LIMIT nalysis performed according to the following methods: PCB in
Solid Waste - SW 846 - Method 3540B, 3550A, 8080A PCB in Transformer
fluids & Waste Oils - EPA 600/ 4-81-045 PCB in Waste Water - EPA 608
Approved By: CELESTINE Title: Supervisor JSCHKEMBACH DEC.10,1998
CLEAN UP IS COMPLETE AT 17:35 AND TAG #20120 WAS PULLED.. S.DIXON "

Remarks: "1/2 gallon unknown oil spill in manhole - spill contained to manhole
- lab samples taken, cleanup pending results. con ed ref #121809"

All Materials:

Site ID: 127589

Operable Unit ID: 1072183

Operable Unit: 01

Material ID: 315153

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010327078 **DIST/DIR:** 0.084 North **ELEVATION:** 18 **MAP ID:** N120

NAME: CON EDISON MANHOLE 1399

Rev: 09/13/2021

ADDRESS: 134 ST & BROOK AVE
BRONX, NY 10451
BRONX

ID/Status: NYP004144515

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20070111

Handler Name: CON EDISON MANHOLE 1399

Handler Address: 134 ST & BROOK AVE

Handler City,State,Zip: BRONX, NY 10451

EPA ID: NYP004144515

Contact Name: MICHAEL D'AGOSTINO

Contact Address: 4 IRVING PL, RM 828

Contact City,State,Zip: NEW YORK, NY 10003

Contact Telephone: 212-580-8383

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Not reported

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: 4 IRVING PL, RM 828

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010327078 **DIST/DIR:** 0.084 North **ELEVATION:** 18 **MAP ID:** N120

NAME: CON EDISON MANHOLE 1399

Rev: 09/13/2021

ADDRESS: 134 ST & BROOK AVE
BRONX, NY 10451
BRONX

ID/Status: NYP004144515

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20070109
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010327078 **DIST/DIR:** 0.084 North **ELEVATION:** 18 **MAP ID:** N120

NAME: CON EDISON MANHOLE 1399

Rev: 09/13/2021

ADDRESS: 134 ST & BROOK AVE
BRONX, NY 10451
BRONX

ID/Status: NYP004144515

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Not reported
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070110
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070111
Handler Name: CON EDISON MANHOLE 1399
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010327078 **DIST/DIR:** 0.084 North **ELEVATION:** 18 **MAP ID:** N120

NAME: CON EDISON MANHOLE 1399

Rev: 09/13/2021

ADDRESS: 134 ST & BROOK AVE
BRONX, NY 10451
BRONX

ID/Status: NYP004144515

SOURCE: US Environmental Protection Agency

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010327046 **DIST/DIR:** 0.084 North **ELEVATION:** 18 **MAP ID:** N121

NAME: CON EDISON MANHOLE 1399

Rev: 09/13/2021

ADDRESS: 134 ST & BROOK AVE
BRONX, NY 10451
BRONX

ID/Status: NYP004144358

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20070111

Handler Name: CON EDISON MANHOLE 1399

Handler Address: 134 ST & BROOK AVE

Handler City,State,Zip: BRONX, NY 10451

EPA ID: NYP004144358

Contact Name: MICHAEL D'AGOSTINO

Contact Address: 4 IRVING PL, RM 828

Contact City,State,Zip: NEW YORK, NY 10003

Contact Telephone: 212-580-8383

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Not reported

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: 4 IRVING PL, RM 828

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010327046	DIST/DIR: 0.084 North	ELEVATION: 18	MAP ID: N121

NAME: CON EDISON MANHOLE 1399

Rev: 09/13/2021

ADDRESS: 134 ST & BROOK AVE
BRONX, NY 10451
BRONX

ID/Status: NYP004144358

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20070109
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010327046 **DIST/DIR:** 0.084 North **ELEVATION:** 18 **MAP ID:** N121

NAME: CON EDISON MANHOLE 1399

Rev: 09/13/2021

ADDRESS: 134 ST & BROOK AVE
BRONX, NY 10451
BRONX

ID/Status: NYP004144358

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Not reported
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070110
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070111
Handler Name: CON EDISON MANHOLE 1399
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1010327046 **DIST/DIR:** 0.084 North **ELEVATION:** 18 **MAP ID:** N121

NAME: CON EDISON MANHOLE 1399

Rev: 09/13/2021

ADDRESS: 134 ST & BROOK AVE
BRONX, NY 10451
BRONX

ID/Status: NYP004144358

SOURCE: US Environmental Protection Agency

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S111738497 **DIST/DIR:** 0.085 East **ELEVATION:** 19 **MAP ID:** P122

NAME: CASTLE OIL TO ROADWAY APPROX 100'

Rev: 08/09/2021

ADDRESS: NEAR 151 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 1113969 / 2012-03-15

ID/Status: 462001

ID/Status: 2012-03-15

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: CASTLE OIL TO ROADWAY APPROX 100'

Address: NEAR 151 BRUCKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 1113969 / 2012-03-15

Facility ID: 1113969

Facility Type: ER

DER Facility ID: 416446

Site ID: 462001

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 2012-03-15

Investigator: SMSANGES

Referred To: Not reported

Reported to Dept: 2012-03-15

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: Not reported

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2012-03-15

Spill Record Last Update: 2012-03-15

Spiller Name: Not reported

Spiller Company: CASTLE OIL

Spiller Address: 290 LOCOST AVE

Spiller Company: 999

Contact Name: RICH CLIFFORD

DEC Memo: "Castle says they had an open vent on the top of one of their trucks.

Driver noticed the spill and stopped. Estimate approx 10 gal spilled
over 100 ft along curb. No street drains were impacted. Castle Depot
was a few blocks away, 4 man crew responded and cleaned with speedie
dry, degreaser etc. Cleanup is complete."

Remarks: "on roadway, contained, c/u in progress"

All Materials:

Site ID: 462001

Operable Unit ID: 1212072

Operable Unit: 01

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S111738497 **DIST/DIR:** 0.085 East **ELEVATION:** 19 **MAP ID:** P122

NAME: CASTLE OIL TO ROADWAY APPROX 100'

Rev: 08/09/2021

ADDRESS: NEAR 151 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 1113969 / 2012-03-15
ID/Status: 462001
ID/Status: 2012-03-15

SOURCE: NY Department of Environmental Conservation

Material ID: 2209909
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000398023	DIST/DIR: 0.090 NW	ELEVATION: 26	MAP ID: Q123

NAME: WEDTECH CORP ADDRESS: 112 BRUCKNER BLVD BRONX, NY 10451 BRONX SOURCE: US Environmental Protection Agency	Rev: 09/13/2021 ID/Status: NYD982273740

RCRA NonGen / NLR:
 Date Form Received by Agency: 20070101
 Handler Name: WEDTECH CORP
 Handler Address: 112 BRUCKNER BLVD
 Handler City,State,Zip: BRONX, NY 10451
 EPA ID: NYD982273740
 Contact Name: Not reported
 Contact Address: GERARD AVE
 Contact City,State,Zip: BRONX, NY 10451
 Contact Telephone: Not reported
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Not reported
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R2
 Mailing Address: GERARD AVE
 Mailing City,State,Zip: BRONX, NY 10451
 Owner Name: WEDTECH CORP
 Owner Type: Private
 Operator Name: WEDTECH CORP
 Operator Type: Private
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000398023 **DIST/DIR:** 0.090 NW **ELEVATION:** 26 **MAP ID:** Q123

NAME: WEDTECH CORP

Rev: 09/13/2021

ADDRESS: 112 BRUCKNER BLVD
BRONX, NY 10451
BRONX

ID/Status: NYD982273740

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Hazardous Waste Summary:
Waste Code: NONE
Waste Description: Not Defined

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000398023 **DIST/DIR:** 0.090 NW **ELEVATION:** 26 **MAP ID:** Q123

NAME: WEDTECH CORP

Rev: 09/13/2021

ADDRESS: 112 BRUCKNER BLVD
BRONX, NY 10451
BRONX

ID/Status: NYD982273740

SOURCE: US Environmental Protection Agency

Handler - Owner Operator:

Owner/Operator Indicator: Operator

Owner/Operator Name: WEDTECH CORP

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: NOT REQUIRED

Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999

Owner/Operator Telephone: 212-555-1212

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: WEDTECH CORP

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: NOT REQUIRED

Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999

Owner/Operator Telephone: 212-555-1212

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: WEDTECH CORP

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: NOT REQUIRED

Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999

Owner/Operator Telephone: 212-555-1212

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19960820

Handler Name: WEDTECH CORP

Federal Waste Generator Description: Not a generator, verified

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000398023 **DIST/DIR:** 0.090 NW **ELEVATION:** 26 **MAP ID:** Q123

NAME: WEDTECH CORP

Rev: 09/13/2021

ADDRESS: 112 BRUCKNER BLVD
BRONX, NY 10451
BRONX

ID/Status: NYD982273740

SOURCE: US Environmental Protection Agency

Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: WEDTECH CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: WEDTECH CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19871001
Handler Name: WEDTECH CORP
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000398023 **DIST/DIR:** 0.090 NW **ELEVATION:** 26 **MAP ID:** Q123

NAME: WEDTECH CORP

Rev: 09/13/2021

ADDRESS: 112 BRUCKNER BLVD
BRONX, NY 10451
BRONX

ID/Status: NYD982273740

SOURCE: US Environmental Protection Agency

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violation:
Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000398023 **DIST/DIR:** 0.090 NW **ELEVATION:** 26 **MAP ID:** Q123

NAME: WEDTECH CORP

Rev: 09/13/2021

ADDRESS: 112 BRUCKNER BLVD
BRONX, NY 10451
BRONX

ID/Status: NYD982273740

SOURCE: US Environmental Protection Agency

Evaluation Date: 19960710

Evaluation Responsible Agency: EPA

Found Violation: No

Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE

Evaluation Responsible Person Identifier: R2RDL

Evaluation Responsible Sub-Organization: RCB

Actual Return to Compliance Date: Not reported

Scheduled Compliance Date: Not reported

Date of Request: Not reported

Date Response Received: Not reported

Request Agency: Not reported

Former Citation: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003074648 **DIST/DIR:** 0.090 NW **ELEVATION:** 26 **MAP ID:** Q124

NAME: 112 BRUCKNER ASSOCIATES,LP **Rev:** 06/21/2021
ADDRESS: 112 BRUCKNER BLVD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

UST:

Name: 112 BRUCKNER ASSOCIATES,LP
Address: 112 BRUCKNER BLVD
City,State,Zip: BRONX, NY 10454
Id/Status: 2-017477 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: N/A
UTM X: 590860.29257
UTM Y: 4517634.94610
Site Type: Unknown

Affiliation Records:

Site Id: 137
Affiliation Type: Facility Owner
Company Name: 112 BRUCKNER ASSOCIATES,LP
Contact Type: Not reported
Contact Name: Not reported
Address1: 733 THIRD AVE #905
Address2: Not reported
City: NEW YORK
State: NY
Zip Code: 10015
Country Code: 001
Phone: (212) 370-1333
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 137

Affiliation Type: Mail Contact
Company Name: 112 BRUCKNER ASSOCIATES
Contact Type: Not reported
Contact Name: JAY B. PARETZKY
Address1: % VESTPRO MANAGEMENT CORPORATION
Address2: 216 EAST 45TH STREET
City: NEW YORK
State: NY
Zip Code: 10017
Country Code: 001
Phone: (212) 370-1333
EMail: Not reported
Fax Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003074648 **DIST/DIR:** 0.090 NW **ELEVATION:** 26 **MAP ID:** Q124

NAME: 112 BRUCKNER ASSOCIATES,LP **Rev:** 06/21/2021

ADDRESS: 112 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 137
Affiliation Type: Facility Operator
Company Name: 112 BRUCKNER ASSOCIATES,LP
Contact Type: Not reported
Contact Name: JYRIS PARTZM
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (212) 402-8612
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 137
Affiliation Type: Emergency Contact
Company Name: 112 BRUCKNER ASSOCIATES,LP
Contact Type: Not reported
Contact Name: JYRIS PARTZM
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (212) 402-8612
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 001
Tank ID: 27029
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 2000

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003074648 **DIST/DIR:** 0.090 NW **ELEVATION:** 26 **MAP ID:** Q124

NAME: 112 BRUCKNER ASSOCIATES,LP

Rev: 06/21/2021

ADDRESS: 112 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Install Date: 05/01/1984
Date Tank Closed: 11/01/1991
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S118262104	DIST/DIR: 0.092 NNW	ELEVATION: 26	MAP ID: R125

NAME: 111 BRUCKNER BLVD LLC

Rev: 08/09/2021

ADDRESS: 111 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 1506954 / 2015-12-29

ID/Status: 514404

ID/Status: 2015-10-01

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: 111 BRUCKNER BLVD LLC

Address: 111 BRUCKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 1506954 / 2015-12-29

Facility ID: 1506954

Facility Type: ER

DER Facility ID: 468873

Site ID: 514404

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: D1

SWIS: 0301

Spill Date: 2015-10-01

Investigator: RMPiPER

Referred To: Not reported

Reported to Dept: 2015-10-01

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2015-10-01

Spill Record Last Update: 2015-12-29

Spiller Name: JOHN CUDNEY

Spiller Company: 111 BRUCKNER BLVD LLC

Spiller Address: 111 BRUCKNER BLVD

Spiller Company: 999

Contact Name: JOHN CUDNEY

DEC Memo: "10/1/2015 - Feng - Duty Desk. left Amec Foster Wheeler message for a call back (516-622-2254) 10/1/2015 - Feng - Eric Weinstock (Eric.Weinstock@AmecFW.com) called back. They are doing a Phase 2 investigation for property transaction. There is a tank out-of-service in the basement. The tank is a 4,000-gallon #6 oil AST. A small portion, about 5% of the tank is sitting on soil. They planned to do the assessment, pump out the tank, and then remove the tank. Soil borings were done around the tank today. The investigation show impacted soil. Bedrock is at 3 feet below the basement floor and 2 feet of product (#6 oil) on top of the bedrock. He believe the

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S118262104 **DIST/DIR:** 0.092 NNW **ELEVATION:** 26 **MAP ID:** R125

NAME: 111 BRUCKNER BLVD LLC

Rev: 08/09/2021

ADDRESS: 111 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 1506954 / 2015-12-29

ID/Status: 514404

ID/Status: 2015-10-01

SOURCE: NY Department of Environmental Conservation

contamination has been delineated and he will talk to his technical personnel for remedial alternatives. He will put together the Phase 2 report and remedial action work plan to submit to the DEC. Owner: John Cudney 111 Bruckner Blvd LLC 111 Bruckner Blvd Bronx, NY 10454 203-962-5993 John.Cudney@gmail.com 10/2/2015 - Feng - Talked to the property owner John Cudney (203-962-5993). He explained that his father bought this property 40 years ago and the tank was there prior to that even. It is a retired tank. They never touched the tank. The building was changed to gas right after they bought it. The current use of the property is commercial, light manufacture including assemble and shipping. Right now he is trying to sell the property. The future use of the property is upon the buyer. They plan to remove the soil while removing the tank. They shall have the plan in 2 weeks. Advised him that a letter will be sent to him and the spill will be assigned to Ryan Piper. CSL letter to John Cudney and cc Eric Weinstock and Ryan Piper via email. Spill is assigned to Ryan Piper. 12/29/15- DEC Piper received and reviewed closure report. Based on work to date, this spill is closed. See Dec Docs for report if warranted. Closed. "

Remarks: "tank removal"

All Materials:

Site ID: 514404

Operable Unit ID: 1263599

Operable Unit: 01

Material ID: 2267337

Material Code: 0003A

Material Name: #6 fuel oil

Case No.: Not reported

Material FA: Petroleum

Quantity: Not reported

Units: Not reported

Recovered: Not reported

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019905623	DIST/DIR: 0.100 NNW	ELEVATION: 30	MAP ID: R126

NAME: CON EDISON ADDRESS: 133 BROWN PL BRONX, NY 10454 BRONX SOURCE: US Environmental Protection Agency	Rev: 09/13/2021 ID/Status: NYP004811754

RCRA NonGen / NLR:
 Date Form Received by Agency: 20150723
 Handler Name: CON EDISON
 Handler Address: 133 BROWN PL
 Handler City,State,Zip: BRONX, NY 10454
 EPA ID: NYP004811754
 Contact Name: THOMAS TEELING
 Contact Address: Not reported
 Contact City,State,Zip: Not reported
 Contact Telephone: 212-460-3770
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Private
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R2
 Mailing Address: IRVING PL 15TH FL NE
 Mailing City,State,Zip: NEW YORK, NY 10003
 Owner Name: Not reported
 Owner Type: Not reported
 Operator Name: Not reported
 Operator Type: Not reported
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019905623 **DIST/DIR:** 0.100 NNW **ELEVATION:** 30 **MAP ID:** R126

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 133 BROWN PL
BRONX, NY 10454
BRONX

ID/Status: NYP004811754

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150723
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019905623 **DIST/DIR:** 0.100 NNW **ELEVATION:** 30 **MAP ID:** R126

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 133 BROWN PL
BRONX, NY 10454
BRONX

ID/Status: NYP004811754

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150723
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S110306551 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S127

NAME: 213535; E134 ST AND ST ANN'S AVE

Rev: 08/09/2021

ADDRESS: E134 ST AND ST ANN'S AVE
NEW YORK, NY
BRONX

ID/Status: 0814444 / 2008-09-22

ID/Status: 432587

ID/Status: 2008-09-08

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: 213535; E134 ST AND ST ANN'S AVE

Address: E134 ST AND ST ANN'S AVE

City,State,Zip: NEW YORK, NY

Spill Number/Closed Date: 0814444 / 2008-09-22

Facility ID: 0814444

Facility Type: ER

DER Facility ID: 386556

Site ID: 432587

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: D4

SWIS: 0301

Spill Date: 2008-09-08

Investigator: DMPOKRZY

Referred To: Not reported

Reported to Dept: 2008-12-31

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: Not reported

Last Inspection: Not reported

Recommended Penalty: Not reported

UST Trust: Not reported

Remediation Phase: 0

Date Entered In Computer: 2010-04-16

Spill Record Last Update: 2010-04-16

Spiller Name: ERT DESK

Spiller Company: CON EDISON

Spiller Address: 5030 BROADWAY

Spiller Company: 001

Contact Name: ERT DESK

DEC Memo: ""

Remarks: ""

All Materials:

Site ID: 432587

Operable Unit ID: 1183648

Operable Unit: 01

Material ID: 2177836

Material Code: 0541A

Material Name: dielectric fluid

Case No.: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S110306551	DIST/DIR:	0.100 ENE	ELEVATION:	18	MAP ID:	S127

NAME: 213535; E134 ST AND ST ANN'S AVE

Rev: 08/09/2021

ADDRESS: E134 ST AND ST ANN'S AVE
NEW YORK, NY
BRONX

ID/Status: 0814444 / 2008-09-22
ID/Status: 432587
ID/Status: 2008-09-08

SOURCE: NY Department of Environmental Conservation

Material FA: Petroleum
Quantity: .00
Units: G
Recovered: Not reported
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S110306527 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S128

NAME: 213385; E 134 ST AND ST. ANN'S AVE

Rev: 08/09/2021

ADDRESS: E 134 ST AND ST. ANN'S AVE
NEW YORK, NY
BRONX

ID/Status: 0814420 / 2008-09-30
ID/Status: 432571
ID/Status: 2008-08-27

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: 213385; E 134 ST AND ST. ANN'S AVE

Address: E 134 ST AND ST. ANN'S AVE

City,State,Zip: NEW YORK, NY

Spill Number/Closed Date: 0814420 / 2008-09-30

Facility ID: 0814420

Facility Type: ER

DER Facility ID: 386505

Site ID: 432571

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: D4

SWIS: 0301

Spill Date: 2008-08-27

Investigator: DMPOKRZY

Referred To: Not reported

Reported to Dept: 2008-12-31

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: Not reported

Last Inspection: Not reported

Recommended Penalty: Not reported

UST Trust: Not reported

Remediation Phase: 0

Date Entered In Computer: 2010-04-16

Spill Record Last Update: 2010-04-16

Spiller Name: ERT DESK

Spiller Company: CON EDISON

Spiller Address: 5030 BROADWAY

Spiller Company: 001

Contact Name: ERT DESK

DEC Memo: ""

Remarks: ""

All Materials:

Site ID: 432571

Operable Unit ID: 1183632

Operable Unit: 01

Material ID: 2177820

Material Code: 0541A

Material Name: dielectric fluid

Case No.: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S110306527 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S128

NAME: 213385; E 134 ST AND ST. ANN'S AVE

Rev: 08/09/2021

ADDRESS: E 134 ST AND ST. ANN'S AVE
NEW YORK, NY
BRONX

ID/Status: 0814420 / 2008-09-30
ID/Status: 432571
ID/Status: 2008-08-27

SOURCE: NY Department of Environmental Conservation

Material FA: Petroleum
Quantity: .00
Units: G
Recovered: Not reported
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S107416489 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S129

NAME: VACANT TRAILER

Rev: 08/09/2021

ADDRESS: ST ANNS AVE / E 134 ST
NEW YORK, NY
BRONX

ID/Status: 0509110 / 2005-11-28
ID/Status: 354832
ID/Status: 2005-10-29

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: VACANT TRAILER

Address: ST ANNS AVE / E 134 ST

City,State,Zip: NEW YORK, NY

Spill Number/Closed Date: 0509110 / 2005-11-28

Facility ID: 0509110

Facility Type: ER

DER Facility ID: 304844

Site ID: 354832

DEC Region: 2

Spill Cause: Abandoned Drums

Spill Class: D3

SWIS: 0301

Spill Date: 2005-10-29

Investigator: SFRAHMAN

Referred To: Not reported

Reported to Dept: 2005-10-29

CID: 72

Water Affected: Not reported

Spill Source: Private Dwelling

Spill Notifier: Local Agency

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2005-10-29

Spill Record Last Update: 2005-11-28

Spiller Name: Not reported

Spiller Company: Not reported

Spiller Address: Not reported

Spiller Company: 001

Contact Name: AFROSA AMIN

DEC Memo: "add to next drum run 11.28.05 Sharif// Pumped out on 11.25.05 drum run."

Remarks: "1 55-gallon drum and 5 5-gallon drums of waste oil abandoned in vacant trailer. Need to be picked up."

All Materials:

Site ID: 354832

Operable Unit ID: 1112222

Operable Unit: 01

Material ID: 2102265

Material Code: 0022

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S107416489 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S129

NAME: VACANT TRAILER

Rev: 08/09/2021

ADDRESS: ST ANNS AVE / E 134 ST
NEW YORK, NY
BRONX

ID/Status: 0509110 / 2005-11-28
ID/Status: 354832
ID/Status: 2005-10-29

SOURCE: NY Department of Environmental Conservation

Material Name: waste oil/used oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 80.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S112148277 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S130

NAME: HARLEM RIVER POWER PLANT

Rev: 08/09/2021

ADDRESS: 134TH STREET / ST. ANNS STREET
BRONX, NY
BRONX

ID/Status: 1204408 / 2012-08-03

ID/Status: 467293

ID/Status: 2012-08-02

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: HARLEM RIVER POWER PLANT

Address: 134TH STREET / ST. ANNS STREET

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 1204408 / 2012-08-03

Facility ID: 1204408

Facility Type: ER

DER Facility ID: 421619

Site ID: 467293

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: Not reported

SWIS: 0301

Spill Date: 2012-08-02

Investigator: JBVOUGHT

Referred To: Not reported

Reported to Dept: 2012-08-02

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2012-08-02

Spill Record Last Update: 2012-08-03

Spiller Name: ANGELA SABET

Spiller Company: NY POWER AUTHORITY

Spiller Address: 134TH ST/ST ANNS ST

Spiller Company: 999

Contact Name: ANGELA SABET

DEC Memo: "8/3/12-Vought-Primary off hours responder. Called NY Power Authority (Angela Sabet Ph:718-683-7474) and left message to return call to Vought. Vought received call from and spoke to Angela and Miller responded to site and excavated four 55-gallon drums of gravel which will be disposed of. No sewers affected as per Sabet and spill closed by Vought."

Remarks: "1-2 gallons sprayed to gravel from a failed gasket. Cleanup in progress."

All Materials:

Site ID: 467293

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S112148277 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S130

NAME: HARLEM RIVER POWER PLANT

Rev: 08/09/2021

ADDRESS: 134TH STREET / ST. ANNS STREET
BRONX, NY
BRONX

ID/Status: 1204408 / 2012-08-03
ID/Status: 467293
ID/Status: 2012-08-02

SOURCE: NY Department of Environmental Conservation

Operable Unit ID: 1217250

Operable Unit: 01

Material ID: 2215518

Material Code: 0013

Material Name: lube oil

Case No.: Not reported

Material FA: Petroleum

Quantity: 2.00

Units: G

Recovered: Not reported

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104651537 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S131

NAME: MH29559

Rev: 08/09/2021

ADDRESS: ST ANNS AV/EAST 134 ST
BRONX, NY
BRONX

ID/Status: 0000118 / 2002-01-17

ID/Status: 0209210 / 2003-02-21

ID/Status: 289138

ID/Status: 289139

SOURCE: NY Department of Environmental Conservation

ID/Status: 2000-04-04

SPILLS:

Name: MH 29559

Address: ST ANNS AV/EAST 134 ST

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0000118 / 2002-01-17

Facility ID: 0000118

Facility Type: ER

DER Facility ID: 234157

Site ID: 289138

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2000-04-04

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 2000-04-04

CID: 270

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2000-04-04

Spill Record Last Update: 2002-01-23

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: CALLER

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL Con Ed e2mis #130732 Notes: 4-4-00 1qt unknown oil on

300gal water in manhole 29559. Sample was taken for PCB count.

Cleanup will continue 50-499ppm and EPA ID # requested. Tanker

ordered. EPA # NYP004052726. Removed one pint oil and 250gal water

from manhole. Cleanup method--tanker and double wash. Earthen sump

status floor is broken and making water, no drains affected, no solid

debris removed. 4-5-00 0655hrs LSN 00-03253 <1ppm PCB "

Remarks: "no sewers no waterways on 300 gals water 130732"

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104651537 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S131

NAME: MH29559

Rev: 08/09/2021

ADDRESS: ST ANNS AV/EAST 134 ST
BRONX, NY
BRONX

ID/Status: 0000118 / 2002-01-17

ID/Status: 0209210 / 2003-02-21

ID/Status: 289138

ID/Status: 289139

SOURCE: NY Department of Environmental Conservation

ID/Status: 2000-04-04

All Materials:

Site ID: 289138

Operable Unit ID: 821840

Operable Unit: 01

Material ID: 288388

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Name: MH29559

Address: ST ANNS AV/EAST 134 ST

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0209210 / 2003-02-21

Facility ID: 0209210

Facility Type: ER

DER Facility ID: 234157

Site ID: 289139

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 2002-12-07

Investigator: KMFOLEY

Referred To: Not reported

Reported to Dept: 2002-12-08

CID: Not reported

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 2002-12-08

Spill Record Last Update: 2003-02-21

Spiller Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID:	S104651537	DIST/DIR:	0.100 ENE	ELEVATION:	18	MAP ID:	S131

NAME: MH29559

Rev: 08/09/2021

ADDRESS: ST ANNS AV/EAST 134 ST
BRONX, NY
BRONX

ID/Status: 0000118 / 2002-01-17

ID/Status: 0209210 / 2003-02-21

ID/Status: 289138

ID/Status: 289139

SOURCE: NY Department of Environmental Conservation

ID/Status: 2000-04-04

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: CALLER

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
FOLEY "

Remarks: "clean up pending 30 gals water 146286"

All Materials:

Site ID: 289139

Operable Unit ID: 862384

Operable Unit: 01

Material ID: 516189

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103484768 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S132

NAME: MANHOLE 12350

Rev: 08/09/2021

ADDRESS: 134TH ST & ST ANNS
BRONX, NY
BRONX

ID/Status: 9807836 / 2002-12-30
ID/Status: 68069
ID/Status: 1998-09-27

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 12350

Address: 134TH ST & ST ANNS

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9807836 / 2002-12-30

Facility ID: 9807836

Facility Type: ER

DER Facility ID: 64953

Site ID: 68069

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 1998-09-27

Investigator: CAENGELH

Referred To: Not reported

Reported to Dept: 1998-09-27

CID: 211

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1998-09-27

Spill Record Last Update: 2002-12-30

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: MIKE CESARE

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

ENGELHARDT Con Ed e2mis #120070: 27-SEP-1998 FOD M.ANDERSON (18962)

REPORTED THAT HE FOUND APPROX 1 GAL OF UNKNOWN OIL AND 100 GAL OF

WATER IN MH12350. SUPERVISOR IN ROUTE TO INSTALL NOTIFICATION TAG.

RECORDS INDICATE THAT THE STRUCTURE DOES NOT HAVE A SEWER CONNECTION.

SPILL IS CONTAINED. CLEANUP WILL BE TREATED AS 50-499 PPM PCB. PCB

SAMPLE TO BE TAKEN FOR RECORD PURPOSES. O.S. M.DELVECCHIO REPORTED

THAT TAG #20199 WAS INSTALLED. EPA ID NYP004017422 ASSIGNED. RECEIVED

CALL AT APPROX 12:45 HRS FROM DEC CHRIS ENGELHARDT REGARDING THIS

INCIDENT. REVIEWED OUR PLAN TO CLEAN STRUCTURE AS 50-499 PPM PCB.

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103484768 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S132

NAME: MANHOLE 12350

Rev: 08/09/2021

ADDRESS: 134TH ST & ST ANNS
BRONX, NY
BRONX

ID/Status: 9807836 / 2002-12-30
ID/Status: 68069
ID/Status: 1998-09-27

SOURCE: NY Department of Environmental Conservation

CLEANUP SCHEDULED TO BEGIN ON 3-11 SHIFT. CLEANUP COMPLETE 1810 HRS
9/27. TAG PULLED."

Remarks: "UNKNOWN OIL FOUND IN MANHOLE - UNK PCB COUNT WILL BE TESTING - NO
CLEAN UP"

All Materials:

Site ID: 68069

Operable Unit ID: 1069016

Operable Unit: 01

Material ID: 566470

Material Code: 0066A

Material Name: unknown petroleum

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103575393 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S133

NAME: MANHOLE 6161

Rev: 08/09/2021

ADDRESS: EAST 134 ST & ST ANNS AV
BRONX, NY
BRONX

ID/Status: 9811506 / 2003-02-19

ID/Status: 305201

ID/Status: 1998-12-13

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 6161

Address: EAST 134 ST & ST ANNS AV

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9811506 / 2003-02-19

Facility ID: 9811506

Facility Type: ER

DER Facility ID: 246540

Site ID: 305201

DEC Region: 2

Spill Cause: Unknown

Spill Class: C4

SWIS: 0301

Spill Date: 1998-12-13

Investigator: CAENGELH

Referred To: Not reported

Reported to Dept: 1998-12-13

CID: 211

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1998-12-13

Spill Record Last Update: 2003-02-19

Spiller Name: Not reported

Spiller Company: CON ED

Spiller Address: 4 IRVING PLACE

Spiller Company: 001

Contact Name: FRANK MASSERIA

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
ENGELHARDT E2MIS 121923 O NEGRON BX FLUSH RPTS POSSIBLE CABLE OIL IN
MH 6161 N/S E134 ST 253' W/O ST ANNS AVE..APPROX 10 OZ IN DRY
HOLE..SPILL IS CONTAINED..NO SUMP PUMP PRESENT..WILL ASSUME
50-499..WILL F/U FOR POSSIBLE SEWER CONNECTION AND TAG NUMBER.
NOTE..SPlicing CREW NAME S AT THIS TIME NOT AVAIL FAILED TO REPT THIS
SPILL AT 0800...WAS RPTS BY FLUSH CREW WHEN THEY ARRIVED. CIG
MASSERIA NOTIFIED 0932 HRS CLEANUP COMPLETE 1140 HRS 12/13...PENDING
DRUM PICK/UP DRUM WERE P/U AT 1830 HRS. J SCHLEMBACH "

Remarks: "CON ED # 121923 - 10 OZ OF PRODUCT CLEAN UP PENDING LAB RESULTS

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103575393 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S133

NAME: MANHOLE 6161

Rev: 08/09/2021

ADDRESS: EAST 134 ST & ST ANNS AV
BRONX, NY
BRONX

ID/Status: 9811506 / 2003-02-19
ID/Status: 305201
ID/Status: 1998-12-13

SOURCE: NY Department of Environmental Conservation

TREATING PRODUCT AS 50-499 PPM PCB"

All Materials:

Site ID: 305201

Operable Unit ID: 1068863

Operable Unit: 01

Material ID: 311800

Material Code: 0541A

Material Name: dielectric fluid

Case No.: Not reported

Material FA: Petroleum

Quantity: 1.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103574926 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S134

NAME: MANHOLE 12350

Rev: 08/09/2021

ADDRESS: EAST 134 ST & ST ANNS AV
BRONX, NY
BRONX

ID/Status: 9810958 / 2003-02-14
ID/Status: 305200
ID/Status: 1998-12-01

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 12350

Address: EAST 134 ST & ST ANNS AV

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9810958 / 2003-02-14

Facility ID: 9810958

Facility Type: ER

DER Facility ID: 246540

Site ID: 305200

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C4

SWIS: 0301

Spill Date: 1998-12-01

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 1998-12-01

CID: 211

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1998-12-01

Spill Record Last Update: 2003-02-14

Spiller Name: Not reported

Spiller Company: Not reported

Spiller Address: Not reported

Spiller Company: Not reported

Contact Name: JOE DEVOTI

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL e2mis 121600 DEC. 1, 1998 U.G. SPLICER K. BURNS #11455

FOUND OIL LEAKING FROM CABLE IN MH-12350 DURING AN INSPECTION. CREW

FOUND APPROX 1 PT OF OIL IN MH. OIL WAS CLEANED AS 50 - 499 ppm AND

DISPOSED OF. OIL SPOT DID NOT ENTER AND SEWER OR WATERWAY. SPOT DID

NOT CONTAIN ANY LEAD DEBRIS AND WILL BE TRANSPORTED UNDER THE ONE

TRIP RULE TO VAN NEST YD. CREW REMOVED THE LEAKING SHRINK CAP PLACED

MORE MASTIC ON ENDS AND PUT A NEW SHRINK CAP ON CABLE. ALL WORK

COMPLETED AS OF 14:00.....NM"

Remarks: "ELECTRICAL CABLE LEAK ON JOINT - 1 PINT OF PRODUCT - CLEANED UP BY

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S103574926 **DIST/DIR:** 0.100 ENE **ELEVATION:** 18 **MAP ID:** S134

NAME: MANHOLE 12350

Rev: 08/09/2021

ADDRESS: EAST 134 ST & ST ANNS AV
BRONX, NY
BRONX

ID/Status: 9810958 / 2003-02-14
ID/Status: 305200
ID/Status: 1998-12-01

SOURCE: NY Department of Environmental Conservation

1400 "

All Materials:
Site ID: 305200
Operable Unit ID: 1071852
Operable Unit: 01
Material ID: 314816
Material Code: 0020B
Material Name: cable oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: 1.00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000414051 **DIST/DIR:** 0.100 East **ELEVATION:** 20 **MAP ID:** P135

NAME: O'BRIEN SANITATION CORP

Rev: 06/21/2021

ADDRESS: 155 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

UST:

Name: O'BRIEN SANITATION CORP
Address: 155 BRUCKNER BLVD
City,State,Zip: BRONX, NY 10454
Id/Status: 2-600668 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: N/A
UTM X: 591171.29562
UTM Y: 4517511.05856
Site Type: Trucking/Transportation/Fleet Operation

Affiliation Records:

Site Id: 22648
Affiliation Type: Mail Contact
Company Name: Not reported
Contact Type: Not reported
Contact Name: SAM MARTINO
Address1: 155 BRUCKNER BLVD
Address2: Not reported
City: BRONX
State: NY
Zip Code: 10454
Country Code: 001
Phone: (212) 993-3838
EMail: Not reported
Fax Number: Not reported
Modified By: BVCAMPBE
Date Last Modified: 2011-10-14

Site Id: 22648
Affiliation Type: Facility Operator
Company Name: OBRIEN SANITATION CORP
Contact Type: Not reported
Contact Name: O'BRIEN SANITATION CORP
Address1: Not reported
Address2: Not reported
City: Not reported
State: NY
Zip Code: Not reported
Country Code: 001
Phone: (212) 993-3838
EMail: Not reported
Fax Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000414051 **DIST/DIR:** 0.100 East **ELEVATION:** 20 **MAP ID:** P135

NAME: O'BRIEN SANITATION CORP

Rev: 06/21/2021

ADDRESS: 155 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Modified By: bkfalvey
Date Last Modified: 2009-05-28

Site Id: 22648
Affiliation Type: Emergency Contact
Company Name: OBRIEN SANITATION CORP
Contact Type: Not reported
Contact Name: SAM MARTINO
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (516) 352-1418
Email: Not reported
Fax Number: Not reported
Modified By: bkfalvey
Date Last Modified: 2009-05-28

Site Id: 22648
Affiliation Type: Facility Owner
Company Name: OBRIEN SANITATION CORP
Contact Type: OWNER
Contact Name: SAMUEL MARTINO
Address1: 155 BRUCKNER BLVD
Address2: Not reported
City: BRONX
State: NY
Zip Code: 10454
Country Code: 001
Phone: (212) 993-3838
Email: Not reported
Fax Number: Not reported
Modified By: BVCAMPBE
Date Last Modified: 2011-10-14

Tank Info:

Tank Number: 001
Tank ID: 43247
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 1500

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U000414051 **DIST/DIR:** 0.100 East **ELEVATION:** 20 **MAP ID:** P135

NAME: O'BRIEN SANITATION CORP

Rev: 06/21/2021

ADDRESS: 155 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Install Date: Not reported
Date Tank Closed: 06/23/2003
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0008
Common Name of Substance: Diesel

Tightness Test Method: 00
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: BVCAMPBE
Last Modified: 04/14/2017

Equipment Records:

A01 - Tank Internal Protection - Epoxy Liner
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction Dispenser
G01 - Tank Secondary Containment - Diking (Aboveground)
I05 - Overfill - Vent Whistle
B01 - Tank External Protection - Painted/Asphalt Coating

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

SWF/LF

EDR ID: U000414051 **DIST/DIR:** 0.100 East **ELEVATION:** 20 **MAP ID:** P135

NAME: O'BRIEN SANITATION CORP

Rev: 03/31/2021

ADDRESS: 155 BRUCKNER BLVD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

SWF/LF:

Name: O'BRIEN SANITATION
Address: 155 BRUCKNER BLVD.
City,State,Zip: BRONX, NY 10454
Flag: INACTIVE
Region Code: 2
Phone Number: 2129933838
Owner Name: Not reported
Owner Type: Not reported
Owner Address: Not reported
Owner Addr2: Not reported
Owner City,St,Zip: Not reported
Owner Email: Not reported
Owner Phone: Not reported
Contact Name: CHARLES MARTINO
Contact Address: Not reported
Contact Addr2: Not reported
Contact City,St,Zip: Not reported
Contact Email: Not reported
Contact Phone: Not reported
Activity Desc: Transfer station - permit
Activity Number: [03T50]
Active: No
East Coordinate: 591100
North Coordinate: 4517600
Accuracy Code: Not reported
Regulatory Status: Not reported
Waste Type: Not reported
Authorization #: 2-6007-00098
Authorization Date: Not reported
Expiration Date: Not reported
Operator Name: Not reported
Operator Type: Not reported
Laste Date: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S102149671 **DIST/DIR:** 0.108 East **ELEVATION:** 19 **MAP ID:** T136

NAME: NYCDEP-SEWAGE TREATMENT

Rev: 08/09/2021

ADDRESS: 158 BUECKNER BLVD
BRONX, NY
BRONX

ID/Status: 9415509 / 2004-04-29
ID/Status: 154762
ID/Status: 1995-02-27

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: NYCDEP-SEWAGE TREATMENT

Address: 158 BUECKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9415509 / 2004-04-29

Facility ID: 9415509

Facility Type: ER

DER Facility ID: 131187

Site ID: 154762

DEC Region: 2

Spill Cause: Unknown

Spill Class: C3

SWIS: 0301

Spill Date: 1995-02-27

Investigator: ADZHITOM

Referred To: Not reported

Reported to Dept: 1995-02-27

CID: Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1995-04-20

Spill Record Last Update: 2004-04-29

Spiller Name: Not reported

Spiller Company: NYC DEP

Spiller Address: SAME

Spiller Company: 001

Contact Name: Not reported

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
ZHITOMIRSKY 04/29/04: Closed by Rashid Ahmed."

Remarks: "OIL COMING OUT OF GRID CHAMBER. UNKNOWN AMOUNT, SEWAGE TREATMENT
PLANT"

All Materials:

Site ID: 154762

Operable Unit ID: 1012799

Operable Unit: 01

Material ID: 370693

Material Code: 0066A

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S102149671 **DIST/DIR:** 0.108 East **ELEVATION:** 19 **MAP ID:** T136

NAME: NYCDEP-SEWAGE TREATMENT

Rev: 08/09/2021

ADDRESS: 158 BUECKNER BLVD
BRONX, NY
BRONX

ID/Status: 9415509 / 2004-04-29
ID/Status: 154762
ID/Status: 1995-02-27

SOURCE: NY Department of Environmental Conservation

Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: L
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019903305 **DIST/DIR:** 0.112 SE **ELEVATION:** 19 **MAP ID:** U137

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 600 E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP004783932

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150518

Handler Name: CON EDISON

Handler Address: 600 E 132ND ST

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004783932

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019903305 **DIST/DIR:** 0.112 SE **ELEVATION:** 19 **MAP ID:** U137

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 600 E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP004783932

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150518
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019903305 **DIST/DIR:** 0.112 SE **ELEVATION:** 19 **MAP ID:** U137

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 600 E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP004783932

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150518
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901714	DIST/DIR: 0.112 SE	ELEVATION: 19	MAP ID: U138

NAME: CON EDISON ADDRESS: 600 E 132ND ST FRONT OF BRONX, NY 10454 BRONX SOURCE: US Environmental Protection Agency	Rev: 09/13/2021 ID/Status: NYP004765152

RCRA NonGen / NLR:
 Date Form Received by Agency: 20150408
 Handler Name: CON EDISON
 Handler Address: 600 E 132ND ST FRONT OF
 Handler City,State,Zip: BRONX, NY 10454
 EPA ID: NYP004765152
 Contact Name: THOMAS TEELING
 Contact Address: Not reported
 Contact City,State,Zip: Not reported
 Contact Telephone: 212-460-3770
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Private
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R2
 Mailing Address: IRVING PL 15TH FL NE
 Mailing City,State,Zip: NEW YORK, NY 10003
 Owner Name: Not reported
 Owner Type: Not reported
 Operator Name: Not reported
 Operator Type: Not reported
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901714 **DIST/DIR:** 0.112 SE **ELEVATION:** 19 **MAP ID:** U138

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 600 E 132ND ST FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004765152

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150408
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019901714 **DIST/DIR:** 0.112 SE **ELEVATION:** 19 **MAP ID:** U138

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 600 E 132ND ST FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004765152

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150408
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1024891826 **DIST/DIR:** 0.112 SE **ELEVATION:** 19 **MAP ID:** U139

NAME: CON EDISON - MANHOLE M29292

Rev: 09/13/2021

ADDRESS: 600 E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP005152780

SOURCE: US Environmental Protection Agency

RCRA-LQG:

Date Form Received by Agency: 20180410
Handler Name: CON EDISON - MANHOLE M29292
Handler Address: 600 E 132ND ST
Handler City,State,Zip: BRONX, NY 10454
EPA ID: NYP005152780
Contact Name: ALYSSA SOTTO
Contact Address: IRVING PLACE, 15TH FL NE
Contact City,State,Zip: NEW YORK, NY 10003
Contact Telephone: 212-460-2757
Contact Fax: Not reported
Contact Email: SOTTOA@CONED.COM
Contact Title: ASSOCIATE SCIENTIST
EPA Region: 02
Land Type: Private
Federal Waste Generator Description: Large Quantity Generator
Non-Notifier: Not reported
Biennial Report Cycle: 2017
Accessibility: Not reported
Active Site Indicator: Handler Activities
State District Owner: NY
State District: NYSDEC R2
Mailing Address: IRVING PLACE, 15TH FL NE
Mailing City,State,Zip: NEW YORK, NY 10003
Owner Name: CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner Type: Private
Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.
Operator Type: Private
Short-Term Generator Activity: No
Importer Activity: No
Mixed Waste Generator: No
Transporter Activity: No
Transfer Facility Activity: No
Recycler Activity with Storage: No
Small Quantity On-Site Burner Exemption: No
Smelting Melting and Refining Furnace Exemption: No
Underground Injection Control: No
Off-Site Waste Receipt: No
Universal Waste Indicator: No
Universal Waste Destination Facility: No
Federal Universal Waste: No
Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
Active Site Converter Treatment storage and Disposal Facility: Not reported
Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1024891826	DIST/DIR: 0.112 SE	ELEVATION: 19	MAP ID: U139

NAME: CON EDISON - MANHOLE M29292

Rev: 09/13/2021

ADDRESS: 600 E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP005152780

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20181106
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: No
Manifest Broker: No
Sub-Part P Indicator: No

Biennial: List of Years
Year: 2017

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1024891826 **DIST/DIR:** 0.112 SE **ELEVATION:** 19 **MAP ID:** U139

NAME: CON EDISON - MANHOLE M29292

Rev: 09/13/2021

ADDRESS: 600 E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP005152780

SOURCE: US Environmental Protection Agency

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code: D008

Waste Description: LEAD

Handler - Owner Operator:

Owner/Operator Indicator: Owner

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20171018

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: 212-460-2757

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: CONSOLIDATED EDISON COMPANY OF NY, INC.

Legal Status: Private

Date Became Current: 20171018

Date Ended Current: Not reported

Owner/Operator Address: 4 IRVING PLACE

Owner/Operator City,State,Zip: NEW YORK, NY 10003

Owner/Operator Telephone: 212-460-2757

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20180410

Handler Name: CON EDISON - MANHOLE M29292

Federal Waste Generator Description: Large Quantity Generator

State District Owner: NY

Large Quantity Handler of Universal Waste: No

Recognized Trader Importer: No

Recognized Trader Exporter: No

Spent Lead Acid Battery Importer: No

Spent Lead Acid Battery Exporter: No

Current Record: Yes

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA-LQG

EDR ID: 1024891826 **DIST/DIR:** 0.112 SE **ELEVATION:** 19 **MAP ID:** U139

NAME: CON EDISON - MANHOLE M29292

Rev: 09/13/2021

ADDRESS: 600 E 132ND ST
BRONX, NY 10454
BRONX

ID/Status: NYP005152780

SOURCE: US Environmental Protection Agency

Non Storage Recycler Activity: No
Electronic Manifest Broker: No

List of NAICS Codes and Descriptions:

NAICS Code: 221122

NAICS Description: ELECTRIC POWER DISTRIBUTION

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S102142898 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q140

NAME: 102 BRUCKNER BLVD/MUFFLER

Rev: 08/09/2021

ADDRESS: 102 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9202017 / 2003-03-14

ID/Status: 1109783 / 2011-11-04

ID/Status: 271873

ID/Status: 457565

ID/Status: 1992-05-16

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: 102 BRUCKNER BLVD/MUFFLER

Address: 102 BRUCKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9202017 / 2003-03-14

Facility ID: 9202017

Facility Type: ER

DER Facility ID: 221278

Site ID: 271873

DEC Region: 2

Spill Cause: Housekeeping

Spill Class: A3

SWIS: 0301

Spill Date: 1992-05-16

Investigator: BATTISTA

Referred To: Not reported

Reported to Dept: 1992-05-19

CID: Not reported

Water Affected: Not reported

Spill Source: Gasoline Station or other PBS Facility

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: True

Remediation Phase: 0

Date Entered In Computer: 1992-05-22

Spill Record Last Update: 2003-03-14

Spiller Name: Not reported

Spiller Company: Not reported

Spiller Address: Not reported

Spiller Company: 001

Contact Name: Not reported

DEC Memo: ""

Remarks: "CONTAMINATED SOIL; STOCKPILED, TESTED, BY ALLIED ENV. WILL DISPOSE.
NYCFD NOTIFIED."

All Materials:

Site ID: 271873

Operable Unit ID: 969351

Operable Unit: 01

Material ID: 567489

Material Code: 0009

Material Name: gasoline

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S102142898 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q140

NAME: 102 BRUCKNER BLVD/MUFFLER

Rev: 08/09/2021

ADDRESS: 102 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9202017 / 2003-03-14

ID/Status: 1109783 / 2011-11-04

ID/Status: 271873

ID/Status: 457565

ID/Status: 1992-05-16

SOURCE: NY Department of Environmental Conservation

Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: L
Recovered: .00
Oxygenate: Not reported

Name: APPLE AUTO & TRUCK CARE
Address: 102 BRUCKNER BLVD
City,State,Zip: BRONX, NY
Spill Number/Closed Date: 1109783 / 2011-11-04
Facility ID: 1109783
Facility Type: ER
DER Facility ID: 221278
Site ID: 457565
DEC Region: 2
Spill Cause: Unknown
Spill Class: C4
SWIS: 0301
Spill Date: 2011-11-04
Investigator: HRPATEL
Referred To: Not reported
Reported to Dept: 2011-11-04
CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station or other PBS Facility
Spill Notifier: Citizen
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2011-11-04
Spill Record Last Update: 2011-11-04
Spiller Name: RICH CAIOLA
Spiller Company: APPLE AUTO & TRUCK CARE
Spiller Address: 102 BRUCKNER BLVD
Spiller Company: 999
Contact Name: Not reported
DEC Memo: "Petroleum from Apple Auto/Gulf Station is leaking through the basement wall of the neighboring building (address unknown). When you stand in the street facing the Apple Auto building, the building to the left has gasoline coming through it's basement wall.

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S102142898 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q140

NAME: 102 BRUCKNER BLVD/MUFFLER

Rev: 08/09/2021

ADDRESS: 102 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 9202017 / 2003-03-14

ID/Status: 1109783 / 2011-11-04

ID/Status: 271873

ID/Status: 457565

ID/Status: 1992-05-16

SOURCE: NY Department of Environmental Conservation

11/04/11-Hiralkumar Patel. alternate address of Apple Auto & Truck Care: none PBS #: 2-399000. as per PBS record, thirteen (13) 550 gal gasoline USTs were removed in Aug. 1991. currently, there are one 4,000 gal diesel UST, two 4,000 gal gasoline USTs, one 275 gal lube oil AST on legs and one 275 gal waste oil AST on legs. other spill #: 9202017. spill 9202017 was reported on 05/19/1992 as found contaminated soil. case closed. no notes in DEC Remarks and no documents on e-docs. 10:41 AM:- left message at Storage Post, property adjacent to Apple Auto and Truck Care. Storage Post 112 Bruckner Blvd Bronx, NY 10454 Ph. (866) 745-7678 (718) 402-8612 10:53 AM:- spoke with person who reported spill. he used to work at Apple Auto. he mentioned that the he heard third party talking about oil seeping into storage post but doesn't know the person who was complaining about spill. 10:55 AM:- spoke with Richard Caiola, manager of Apple Auto Care. he has no knowledge of spill. Rich will talk to neighbour and ask them to call. Richard Caiola Apple Auto and Truck Care Ph. (718) 585-8798 11:16 AM:- spoke with Graciera at Storage Post. she doesn't know anything about spill in basement. she will check and call back. 12:39 PM:- received call from Graciera. she checked basement and confirmed no spill in basement. based on available information, case closed."

Remarks: "Fuel seeping through the walls of the basement at location. Caller would like to remain anonymous for anyone outside of the DEC."

All Materials:

Site ID: 457565

Operable Unit ID: 1207693

Operable Unit: 01

Material ID: 2204987

Material Code: 0001A

Material Name: #2 fuel oil

Case No.: Not reported

Material FA: Petroleum

Quantity: Not reported

Units: Not reported

Recovered: Not reported

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000432444 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q141

NAME: SERVICE STATION **Rev:** 09/13/2021
ADDRESS: 102 BRUCKNER BLVD **ID/Status:** NYD000698597
BRONX, NY 10454
BRONX
SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:
Date Form Received by Agency: 20070101
Handler Name: SERVICE STATION
Handler Address: 102 BRUCKNER BLVD
Handler City,State,Zip: BRONX, NY 10454-4515
EPA ID: NYD000698597
Contact Name: Not reported
Contact Address: BRUCKNER BLVD
Contact City,State,Zip: BRONX, NY 10454
Contact Telephone: Not reported
Contact Fax: Not reported
Contact Email: Not reported
Contact Title: Not reported
EPA Region: 02
Land Type: Not reported
Federal Waste Generator Description: Not a generator, verified
Non-Notifier: Not reported
Biennial Report Cycle: Not reported
Accessibility: Not reported
Active Site Indicator: Not reported
State District Owner: NY
State District: NYSDEC R2
Mailing Address: BRUCKNER BLVD
Mailing City,State,Zip: BRONX, NY 10454
Owner Name: SUN OIL COMPANY OF PENNSYLVANIA
Owner Type: Private
Operator Name: SUN OIL COMPANY OF PENNSYLVANIA
Operator Type: Private
Short-Term Generator Activity: No
Importer Activity: No
Mixed Waste Generator: No
Transporter Activity: No
Transfer Facility Activity: No
Recycler Activity with Storage: No
Small Quantity On-Site Burner Exemption: No
Smelting Melting and Refining Furnace Exemption: No
Underground Injection Control: No
Off-Site Waste Receipt: No
Universal Waste Indicator: No
Universal Waste Destination Facility: No
Federal Universal Waste: No
Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
Active Site Converter Treatment storage and Disposal Facility: Not reported
Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000432444 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q141

NAME: SERVICE STATION

Rev: 09/13/2021

ADDRESS: 102 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYD000698597

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Hazardous Waste Summary:
Waste Code: D000
Waste Description: Not Defined

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000432444 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q141

NAME: SERVICE STATION

Rev: 09/13/2021

ADDRESS: 102 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYD000698597

SOURCE: US Environmental Protection Agency

Waste Code: D001

Waste Description: IGNITABLE WASTE

Handler - Owner Operator:

Owner/Operator Indicator: Owner

Owner/Operator Name: SUN OIL COMPANY OF PENNSYLVANIA

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: NOT REQUIRED

Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999

Owner/Operator Telephone: 212-555-1212

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator

Owner/Operator Name: SUN OIL COMPANY OF PENNSYLVANIA

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: NOT REQUIRED

Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999

Owner/Operator Telephone: 212-555-1212

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner

Owner/Operator Name: SUN OIL COMPANY OF PENNSYLVANIA

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: NOT REQUIRED

Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999

Owner/Operator Telephone: 212-555-1212

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19990708

Handler Name: SERVICE STATION

Federal Waste Generator Description: Not a generator, verified

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000432444 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q141

NAME: SERVICE STATION **Rev:** 09/13/2021
ADDRESS: 102 BRUCKNER BLVD **ID/Status:** NYD000698597
BRONX, NY 10454
BRONX
SOURCE: US Environmental Protection Agency

State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: SERVICE STATION
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: SERVICE STATION
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19800818
Handler Name: SERVICE STATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1000432444 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q141

NAME: SERVICE STATION

Rev: 09/13/2021

ADDRESS: 102 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: NYD000698597

SOURCE: US Environmental Protection Agency

Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018279216 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q142

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 102 BRUCKNER BLVD FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004740197

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150301

Handler Name: CON EDISON

Handler Address: 102 BRUCKNER BLVD FRONT OF

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004740197

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL, 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018279216 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q142

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 102 BRUCKNER BLVD FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004740197

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDs Where RCRA CA has Been Imposed Universe: No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSD Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160502
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150301
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018279216 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q142

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 102 BRUCKNER BLVD FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004740197

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150301
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q143

NAME: APPLE AUTO & TRUCK CARE, INC. **Rev:** 06/21/2021
ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX
SOURCE: NY Department of Environmental Conservation

UST:

Name: APPLE AUTO & TRUCK CARE, INC.
Address: 102 BRUCKNER BOULEVARD
City,State,Zip: BRONX, NY 10454
Id/Status: 2-399000 / Active
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: 10/27/2022
UTM X: 590819.96945
UTM Y: 4517641.57619
Site Type: Retail Gasoline Sales

Affiliation Records:

Site Id: 18982
Affiliation Type: Mail Contact
Company Name: APPLE AUTO & TRUCK CARE, INC.
Contact Type: Not reported
Contact Name: RICHARD CAIOLA
Address1: 102 BRUCKNER BOULEVARD
Address2: Not reported
City: BRONX
State: NY
Zip Code: 10454
Country Code: 001
Phone: (914) 954-6606
EMail: APPLEAUTOCARE@AOL.COM
Fax Number: Not reported
Modified By: DMPOKRZY
Date Last Modified: 2017-10-27

Site Id: 18982
Affiliation Type: Facility Operator
Company Name: APPLE AUTO & TRUCK CARE, INC.
Contact Type: Not reported
Contact Name: RICHARD CAIOLA
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 585-8798
EMail: Not reported
Fax Number: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q143

NAME: APPLE AUTO & TRUCK CARE, INC. **Rev:** 06/21/2021

ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Modified By: AYLAGATI
Date Last Modified: 2016-11-03

Site Id: 18982
Affiliation Type: Emergency Contact
Company Name: RICHARD CAIOLA
Contact Type: Not reported
Contact Name: RICHARD CAIOLA
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (914) 954-6606
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 2007-06-05

Site Id: 18982
Affiliation Type: Facility Owner
Company Name: 102 BRUCKNER BOULEVARD REALTY LLC
Contact Type: Not reported
Contact Name: RICHARD CAIOLA
Address1: 39 OAK ROAD
Address2: Not reported
City: KATONAH
State: NY
Zip Code: 10536
Country Code: 001
Phone: (914) 954-6606
Email: Not reported
Fax Number: Not reported
Modified By: DMPOKRZY
Date Last Modified: 2017-10-27

Tank Info:

Tank Number: 001
Tank ID: 21574
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q143

NAME: APPLE AUTO & TRUCK CARE, INC.

Rev: 06/21/2021

ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Install Date: Not reported
Date Tank Closed: 08/01/1991
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 10/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 002
Tank ID: 21575
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 08/01/1991
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 10/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 DIST/DIR: 0.112 NW ELEVATION: 29 MAP ID: Q143

NAME: APPLE AUTO & TRUCK CARE, INC.

Rev: 06/21/2021

ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Last Modified: 04/14/2017

Equipment Records:

J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 003

Tank ID: 21576

Tank Status: Closed - Removed

Material Name: Closed - Removed

Capacity Gallons: 550

Install Date: Not reported

Date Tank Closed: 08/01/1991

Registered: True

Tank Location: Underground

Tank Type: Steel/carbon steel

Material Code: 0009

Common Name of Substance: Gasoline

Tightness Test Method: 01

Date Test: 10/01/1987

Next Test Date: Not reported

Pipe Model: Not reported

Modified By: TRANSLAT

Last Modified: 04/14/2017

Equipment Records:

J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q143

NAME: APPLE AUTO & TRUCK CARE, INC.

Rev: 06/21/2021

ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Tank Number: 004
Tank ID: 21577
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 08/01/1991
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 10/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 005
Tank ID: 21578
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 08/01/1991
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q143

NAME: APPLE AUTO & TRUCK CARE, INC.

Rev: 06/21/2021

ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Tightness Test Method: 01
Date Test: 10/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 006
Tank ID: 21579
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 08/01/1991
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 10/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q143

NAME: APPLE AUTO & TRUCK CARE, INC.

Rev: 06/21/2021

ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 007
Tank ID: 21580
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 08/01/1991
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 10/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 008
Tank ID: 21581
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 08/01/1991
Registered: True

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q143

NAME: APPLE AUTO & TRUCK CARE, INC.

Rev: 06/21/2021

ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 10/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

J02 - Dispenser - Suction Dispenser
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 009
Tank ID: 21582
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 08/01/1991
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 10/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

J02 - Dispenser - Suction Dispenser

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q143

NAME: APPLE AUTO & TRUCK CARE, INC.

Rev: 06/21/2021

ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 010
Tank ID: 21583
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 08/01/1991
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 10/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 011
Tank ID: 21584
Tank Status: Closed - Removed

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q143

NAME: APPLE AUTO & TRUCK CARE, INC.

Rev: 06/21/2021

ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 08/01/1991
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 10/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
G03 - Tank Secondary Containment - Vault (w/o access)

Tank Number: 012
Tank ID: 21585
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 08/01/1991
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 10/01/1987
Next Test Date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q143

NAME: APPLE AUTO & TRUCK CARE, INC.

Rev: 06/21/2021

ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
G03 - Tank Secondary Containment - Vault (w/o access)

Tank Number: 013
Tank ID: 21586
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: Not reported
Date Tank Closed: 08/01/1991
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 10/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
I00 - Overfill - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q143

NAME: APPLE AUTO & TRUCK CARE, INC.

Rev: 06/21/2021

ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Tank Number: 014
Tank ID: 41881
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 05/01/1992
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 0008
Common Name of Substance: Diesel

Tightness Test Method: 20
Date Test: 12/01/1998
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: DMPOKRZY
Last Modified: 10/27/2017

Equipment Records:

L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
J01 - Dispenser - Pressurized Dispenser
E04 - Piping Secondary Containment - Double walled UG
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 015
Tank ID: 41882
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 05/01/1992
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q143

NAME: APPLE AUTO & TRUCK CARE, INC.

Rev: 06/21/2021

ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Tank Type: Equivalent technology
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: 20
Date Test: 12/01/1998
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: DMPOKRZY
Last Modified: 10/27/2017

Equipment Records:

C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
B04 - Tank External Protection - Fiberglass
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 016
Tank ID: 41883
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 05/01/1992
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 2712
Common Name of Substance: Gasoline/Ethanol

Tightness Test Method: 20
Date Test: 12/01/1998
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: DMPOKRZY

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

UST

EDR ID: U003127992 **DIST/DIR:** 0.112 NW **ELEVATION:** 29 **MAP ID:** Q143

NAME: APPLE AUTO & TRUCK CARE, INC.

Rev: 06/21/2021

ADDRESS: 102 BRUCKNER BOULEVARD
BRONX, NY 10454
BRONX

SOURCE: NY Department of Environmental Conservation

Last Modified: 10/27/2017

Equipment Records:

- C02 - Pipe Location - Underground/On-ground
- L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
- H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
- A00 - Tank Internal Protection - None
- E04 - Piping Secondary Containment - Double walled UG
- J01 - Dispenser - Pressurized Dispenser
- F04 - Pipe External Protection - Fiberglass
- B04 - Tank External Protection - Fiberglass
- D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
- I02 - Overfill - High Level Alarm
- K01 - Spill Prevention - Catch Basin
- L07 - Piping Leak Detection - Pressurized Piping Leak Detector
- G04 - Tank Secondary Containment - Double-Walled (Underground)

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104648633 **DIST/DIR:** 0.114 NE **ELEVATION:** 35 **MAP ID:** 144

NAME: SPILL NUMBER 9814306

Rev: 08/09/2021

ADDRESS: 135TH ST & ST ANNE'S AVE
BRONX, NY
BRONX

ID/Status: 9814306 / 2004-01-22

ID/Status: 162555

ID/Status: 1999-02-28

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: SPILL NUMBER 9814306

Address: 135TH ST & ST ANNE'S AVE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9814306 / 2004-01-22

Facility ID: 9814306

Facility Type: ER

DER Facility ID: 137147

Site ID: 162555

DEC Region: 2

Spill Cause: Equipment Failure

Spill Class: C3

SWIS: 0301

Spill Date: 1999-02-28

Investigator: CAENGELH

Referred To: Not reported

Reported to Dept: 1999-02-28

CID: 312

Water Affected: Not reported

Spill Source: Commercial Vehicle

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1999-02-28

Spill Record Last Update: 2004-01-22

Spiller Name: Not reported

Spiller Company: CON EDISON

Spiller Address: 4 IRVING PLACE

Spiller Company: 999

Contact Name: Not reported

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
ENGELHARDT CC: MULQUEEN, FAXED TO NYCDEP. ~~~~~ e2mis no.

123331: 02/28/99 1028 HRS HYDRILIC HOSE BROKE ON TK 6040. APPX 5 GALS

FLUID ON GROUND & APPX LESS THAN 1 QT WENT INTO SEWER . FL CREW IS

CLEANING UP SPILL WITH OIL ABSORBER & PADS. ALSO THEY ARE USING PADS

TO CLEAN UP FLUID IN SEWER. 02/28/99 1250 HRS CLEAN UP COMPLETE"

Remarks: "VEH HAD A BROKEN HYD. LINE (VEH #60403) - ABOUT 1 QT WENT INTO SEWER"
Not reported

All Materials:

Site ID: 162555

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104648633 **DIST/DIR:** 0.114 NE **ELEVATION:** 35 **MAP ID:** 144

NAME: SPILL NUMBER 9814306

Rev: 08/09/2021

ADDRESS: 135TH ST & ST ANNE'S AVE
BRONX, NY
BRONX

ID/Status: 9814306 / 2004-01-22

ID/Status: 162555

ID/Status: 1999-02-28

SOURCE: NY Department of Environmental Conservation

Operable Unit ID: 1071723

Operable Unit: 01

Material ID: 311003

Material Code: 0010

Material Name: hydraulic oil

Case No.: Not reported

Material FA: Petroleum

Quantity: 5.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280139 **DIST/DIR:** 0.115 ESE **ELEVATION:** 18 **MAP ID:** T145

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS PL VAULT 2644
BRONX, NY 10454
BRONX

ID/Status: NYP004750014

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150312

Handler Name: CON EDISON

Handler Address: SAINT ANNS PL VAULT 2644

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004750014

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL, 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280139 **DIST/DIR:** 0.115 ESE **ELEVATION:** 18 **MAP ID:** T145

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS PL VAULT 2644
BRONX, NY 10454
BRONX

ID/Status: NYP004750014

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDs Where RCRA CA has Been Imposed Universe: No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSD Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160502
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150312
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280139 **DIST/DIR:** 0.115 ESE **ELEVATION:** 18 **MAP ID:** T145

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS PL VAULT 2644
BRONX, NY 10454
BRONX

ID/Status: NYP004750014

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150312
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280138 **DIST/DIR:** 0.115 ESE **ELEVATION:** 18 **MAP ID:** T146

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS PL VAULT 2130
BRONX, NY 10454
BRONX

ID/Status: NYP004750006

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150312

Handler Name: CON EDISON

Handler Address: SAINT ANNS PL VAULT 2130

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004750006

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL, 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280138 **DIST/DIR:** 0.115 ESE **ELEVATION:** 18 **MAP ID:** T146

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS PL VAULT 2130
BRONX, NY 10454
BRONX

ID/Status: NYP004750006

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDs Where RCRA CA has Been Imposed Universe: No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSD Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160502
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150312
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280138 **DIST/DIR:** 0.115 ESE **ELEVATION:** 18 **MAP ID:** T146

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS PL VAULT 2130
BRONX, NY 10454
BRONX

ID/Status: NYP004750006

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150312
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280140	DIST/DIR: 0.115 ESE	ELEVATION: 18	MAP ID: T147

NAME: CON EDISON ADDRESS: SAINT ANNS PL VAULT 2422 BRONX, NY 10454 BRONX SOURCE: US Environmental Protection Agency	Rev: 09/13/2021 ID/Status: NYP004750022

RCRA NonGen / NLR:
 Date Form Received by Agency: 20150312
 Handler Name: CON EDISON
 Handler Address: SAINT ANNS PL VAULT 2422
 Handler City,State,Zip: BRONX, NY 10454
 EPA ID: NYP004750022
 Contact Name: THOMAS TEELING
 Contact Address: Not reported
 Contact City,State,Zip: Not reported
 Contact Telephone: 212-460-3770
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Private
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R2
 Mailing Address: IRVING PL, 15TH FL NE
 Mailing City,State,Zip: NEW YORK, NY 10003
 Owner Name: Not reported
 Owner Type: Not reported
 Operator Name: Not reported
 Operator Type: Not reported
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280140 **DIST/DIR:** 0.115 ESE **ELEVATION:** 18 **MAP ID:** T147

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS PL VAULT 2422
BRONX, NY 10454
BRONX

ID/Status: NYP004750022

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDFs Where RCRA CA has Been Imposed Universe: No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDFs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSDF Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160502
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150312
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1018280140 **DIST/DIR:** 0.115 ESE **ELEVATION:** 18 **MAP ID:** T147

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: SAINT ANNS PL VAULT 2422
BRONX, NY 10454
BRONX

ID/Status: NYP004750022

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150312
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104194795 **DIST/DIR:** 0.121 SE **ELEVATION:** 19 **MAP ID:** U148

NAME: MANHOLE 5969

Rev: 08/09/2021

ADDRESS: 132 ST

ID/Status: 9906795 / 1999-11-09

BRONX, NY

ID/Status: 203749

BRONX

ID/Status: 1999-09-07

SOURCE: NY Department of Environmental Conservation

SPILLS:

Name: MANHOLE 5969

Address: 132 ST

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9906795 / 1999-11-09

Facility ID: 9906795

Facility Type: ER

DER Facility ID: 169434

Site ID: 203749

DEC Region: 2

Spill Cause: Unknown

Spill Class: C5

SWIS: 0301

Spill Date: 1999-09-07

Investigator: JHOCONNE

Referred To: Not reported

Reported to Dept: 1999-09-07

CID: 365

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 1999-09-07

Spill Record Last Update: 2000-05-24

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller Company: 999

Contact Name: Not reported

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

O'CONNELL con ed e2mis notes: reports 250 gallons of waters and 1/2

quart of oil in MH-5969, oil and water are contained in MH. Plates

indicate there is no sewer connection. Sample was taken. Removed

approx half gallon oil and 385 gal water. Washed hole down with 406

solution...no sewer connections to seal...about 125 solid waste

removed... tag removed "

Remarks: "1/2 quart on 250 gallons of water - clean up pending lab results -
ref 127640"

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

NY Spills

EDR ID: S104194795 **DIST/DIR:** 0.121 SE **ELEVATION:** 19 **MAP ID:** U148

NAME: MANHOLE 5969

Rev: 08/09/2021

ADDRESS: 132 ST
BRONX, NY
BRONX

ID/Status: 9906795 / 1999-11-09
ID/Status: 203749
ID/Status: 1999-09-07

SOURCE: NY Department of Environmental Conservation

All Materials:

Site ID: 203749
Operable Unit ID: 1085229
Operable Unit: 01
Material ID: 299518
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019906164 **DIST/DIR:** 0.125 NNW **ELEVATION:** 38 **MAP ID:** 149

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 468 E 134TH ST FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004817995

SOURCE: US Environmental Protection Agency

RCRA NonGen / NLR:

Date Form Received by Agency: 20150804

Handler Name: CON EDISON

Handler Address: 468 E 134TH ST FRONT OF

Handler City,State,Zip: BRONX, NY 10454

EPA ID: NYP004817995

Contact Name: THOMAS TEELING

Contact Address: Not reported

Contact City,State,Zip: Not reported

Contact Telephone: 212-460-3770

Contact Fax: Not reported

Contact Email: Not reported

Contact Title: Not reported

EPA Region: 02

Land Type: Private

Federal Waste Generator Description: Not a generator, verified

Non-Notifier: Not reported

Biennial Report Cycle: Not reported

Accessibility: Not reported

Active Site Indicator: Not reported

State District Owner: NY

State District: NYSDEC R2

Mailing Address: IRVING PL 15TH FL NE

Mailing City,State,Zip: NEW YORK, NY 10003

Owner Name: Not reported

Owner Type: Not reported

Operator Name: Not reported

Operator Type: Not reported

Short-Term Generator Activity: No

Importer Activity: No

Mixed Waste Generator: No

Transporter Activity: No

Transfer Facility Activity: No

Recycler Activity with Storage: No

Small Quantity On-Site Burner Exemption: No

Smelting Melting and Refining Furnace Exemption: No

Underground Injection Control: No

Off-Site Waste Receipt: No

Universal Waste Indicator: No

Universal Waste Destination Facility: No

Federal Universal Waste: No

Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported

Active Site Converter Treatment storage and Disposal Facility: Not reported

Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019906164 **DIST/DIR:** 0.125 NNW **ELEVATION:** 38 **MAP ID:** 149

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 468 E 134TH ST FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004817995

SOURCE: US Environmental Protection Agency

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRA Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDs Where RCRA CA has Been Imposed Universe: No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSD Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20160909
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Historic Generators:
Receive Date: 20150804
Handler Name: CON EDISON

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

RCRA NonGen / NLR

EDR ID: 1019906164 **DIST/DIR:** 0.125 NNW **ELEVATION:** 38 **MAP ID:** 149

NAME: CON EDISON

Rev: 09/13/2021

ADDRESS: 468 E 134TH ST FRONT OF
BRONX, NY 10454
BRONX

ID/Status: NYP004817995

SOURCE: US Environmental Protection Agency

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150804
Handler Name: CON EDISON
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S100145506 **DIST/DIR:** 0.131 ESE **ELEVATION:** 19 **MAP ID:** 150

NAME: CLOSED-LACKOF RECENT INFO

Rev: 08/09/2021

ADDRESS: USPOSTAL SVC,510 E 133 ST
BRONX, NY
BRONX

ID/Status: 8903777 / 2003-03-05
ID/Status: 75113
ID/Status: 1989-07-14

SOURCE: NY Department of Environmental Conservation

LTANKS:

Name: CLOSED-LACKOF RECENT INFO

Address: USPOSTAL SVC,510 E 133 ST

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 8903777 / 2003-03-05

Facility ID: 8903777

Site ID: 75113

Spill Date: 1989-07-14

Spill Cause: Tank Test Failure

Spill Source: Institutional, Educational, Gov., Other

Spill Class: C4

Cleanup Ceased: Not reported

SWIS: 0301

Investigator: ADMIN. CLOSED

Referred To: Not reported

Reported to Dept: 1989-07-14

CID: Not reported

Water Affected: Not reported

Spill Notifier: Tank Tester

Last Inspection: Not reported

Recommended Penalty: False

Meets Standard: False

UST Involvement: False

Remediation Phase: 0

Date Entered In Computer: 1989-07-17

Spill Record Last Update: 2003-03-14

Spiller Name: Not reported

Spiller Company: US POSTAL SERV

Spiller Address: Not reported

Spiller County: 001

Spiller Contact: Not reported

Spiller Phone: Not reported

Spiller Extention: Not reported

DEC Region: 2

DER Facility ID: 70367

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
ADMIN.CLOSED 03/05/2003- Closed Due To The Nature / Extent Of The
Spill Report"

Remarks: "TWO 10K TANK-SYSTEM FAILS HORNER-EZY. L R = 0.35577GPH. WILL ISOLATE
& RETEST.CLOSED DUE TO LACK OF ANY RECENT INFO- DOES NOT MEET ANY
CLEAN UP REQUIREMENTS."

All TTF:

Facility ID: 8903777

Spill Number: 8903777

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S100145506 **DIST/DIR:** 0.131 ESE **ELEVATION:** 19 **MAP ID:** 150

NAME: CLOSED-LACKOF RECENT INFO

Rev: 08/09/2021

ADDRESS: USPOSTAL SVC,510 E 133 ST
BRONX, NY
BRONX

ID/Status: 8903777 / 2003-03-05

ID/Status: 75113

ID/Status: 1989-07-14

SOURCE: NY Department of Environmental Conservation

Spill Tank Test: 1535720
Site ID: 75113
Tank Number: Not reported
Tank Size: 0
Material: 0001
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:
Site ID: 75113
Operable Unit ID: 931382
Operable Unit: 01
Material ID: 447853
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: L
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622 **DIST/DIR:** 0.162 ESE **ELEVATION:** 19 **MAP ID:** V151

NAME: SOUTH BRONX CHARTER SCHOOL
ADDRESS: 611 EAST 133RD STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 184862
ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Name: SOUTH BRONX CHARTER SCHOOL

Address: 611 EAST 133RD STREET

City,State,Zip: BRONX, NY 10454

Recipient Name: City of New York

Grant Type: BCRLF

Property Number: -

Parcel size: .2

Latitude: 40.8030804

Longitude: -73.9185966

HCM Label: -

Map Scale: -

Point of Reference: -

Highlights: Former Use: The site is located in the Port Morris section in the Bronx. The site is 8,772-square feet and is bounded by Cypress Place to the north, East 133rd Street to the south, Cypress Place to the east, and Cypress Place to the west. Prior to development, the site was vacant but was most recently used as an adult entertainment establishment and contained a two-story 16,000 square foot building. The future use of the site consisted of complete demolition of the previous building for the construction of the new charter school. The new school covers the entire building lot. The total square footage of the school is 39,000 square feet and consists of five floors with no grade-level open spaces.

Datum: North American Datum of 1983

Acres Property ID: 184862

IC Data Access: -

Start Date: 05/01/2013

Redev Completion Date: -

Completed Date: 08/06/2014

Acres Cleaned Up: .2

Cleanup Funding: 35292

Cleanup Funding Source: Private funding

Assessment Funding: -

Assessment Funding Source: -

Redevelopment Funding: -

Redev. Funding Source: -

Redev. Funding Entity Name: -

Redevelopment Start Date: -

Assessment Funding Entity: -

Cleanup Funding Entity: Cost Share

Grant Type: Hazardous

Accomplishment Type: -

Accomplishment Count: -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622 **DIST/DIR:** 0.162 ESE **ELEVATION:** 19 **MAP ID:** V151

NAME: SOUTH BRONX CHARTER SCHOOL
ADDRESS: 611 EAST 133RD STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 184862
ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

Cooperative Agreement Number: 96295712
Start Date: -
Ownership Entity: Private
Completion Date: -
Current Owner: South Bronx Charter School for International Cultures & Arts
Did Owner Change: N
Cleanup Required: Y
Video Available: N
Photo Available: Y
Institutional Controls Required: N
IC Category Proprietary Controls: -
IC Cat. Info. Devices: -
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: N
State/tribal program date: -
State/tribal program ID: -
State/tribal NFA date: 08/06/2014
Air cleaned: -
Asbestos found: -
Asbestos cleaned: -
Controlled substance found: -
Controlled substance cleaned: -
Drinking water affected: -
Drinking water cleaned: -
Groundwater affected: Y
Groundwater cleaned: Y
Lead contaminant found: Y
Lead cleaned up: Y
No media affected: Not reported
Unknown media affected: -
Other cleaned up: -
Other metals found: Y
Other metals cleaned: Y
Other contaminants found: -
Other contams found description: -
PAHs found: -
PAHs cleaned up: -
PCBs found: Y
PCBs cleaned up: Y
Petro products found: -
Petro products cleaned: -
Sediments found: -
Sediments cleaned: -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622 **DIST/DIR:** 0.162 ESE **ELEVATION:** 19 **MAP ID:** V151

NAME: SOUTH BRONX CHARTER SCHOOL
ADDRESS: 611 EAST 133RD STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 184862
ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

Soil affected: Y
Soil cleaned up: Y
Surface water cleaned: -
VOCs found: Y
VOCs cleaned: Y
Cleanup other description: -
Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -
Past use residential acreage: -
Surface Water: -
Past use commercial acreage: .2
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: .2
Future use industrial acreage: -
Superfund Fed. landowner flag: -
Arsenic cleaned up: Y
Cadmium cleaned up: Y
Chromium cleaned up: Y
Copper cleaned up: -
Iron cleaned up: Y
mercury cleaned up: Y
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: Y
Selenium cleaned up: -
SVOCs cleaned up: Y
Unknown clean up: -
Arsenic contaminant found: Y
Cadmium contaminant found: Y
Chromium contaminant found: Y
Copper contaminant found: -
Iron contaminant found: Y
Mercury contaminant found: Y
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: Y
Selenium contaminant found: -
SVOCs contaminant found: Y
Unknown contaminant found: -
Future Use: Multistory 0
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622 **DIST/DIR:** 0.162 ESE **ELEVATION:** 19 **MAP ID:** V151

NAME: SOUTH BRONX CHARTER SCHOOL
ADDRESS: 611 EAST 133RD STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 184862
ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

Indoor air media cleaned up: -

Unknown media cleaned up: -

Past Use: Multistory Not reported

Property Description: The site is located in the Port Morris section in the Bronx. The site is 8,772-square feet and is bounded by Cypress Place to the north, East 133rd Street to the south, Cypress Place to the east, and Cypress Place to the west. Prior to development, the site was vacant but was most recently used as an adult entertainment establishment and contained a two-story 16,000 square foot building. The future use of the site consisted of complete demolition of the previous building for the construction of the new charter school. The new school covers the entire building lot. The total square footage of the school is 39,000 square feet and consists of five floors with no grade-level open spaces.

Below Poverty Number: 10517

Below Poverty Percent: 44.39

Meidan Income: 9315

Meidan Income Number: 17701

Meidan Income Percent: 74.72

Vacant Housing Number: 769

Vacant Housing Percent: 9.09

Unemployed Number: 1594

Unemployed Percent: 6.73

Name: SOUTH BRONX CHARTER SCHOOL

Address: 611 EAST 133RD STREET

City,State,Zip: BRONX, NY 10454

Recipient Name: City of New York

Grant Type: BCRLF

Property Number: -

Parcel size: .2

Latitude: 40.8030804

Longitude: -73.9185966

HCM Label: -

Map Scale: -

Point of Reference: -

Highlights: Former Use: The site is located in the Port Morris section in the Bronx. The site is 8,772-square feet and is bounded by Cypress Place to the north, East 133rd Street to the south, Cypress Place to the east, and Cypress Place to the west. Prior to development, the site was vacant but was most recently used as an adult entertainment establishment and contained a two-story 16,000 square foot building. The future use of the site consisted of complete demolition of the previous building for the construction of the new charter school. The new school covers the entire building lot. The total square footage

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622 **DIST/DIR:** 0.162 ESE **ELEVATION:** 19 **MAP ID:** V151

NAME: SOUTH BRONX CHARTER SCHOOL **Rev:** 06/10/2021
ADDRESS: 611 EAST 133RD STREET ID/Status: 184862
BRONX, NY 10454 ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

of the school is 39,000 square feet and consists of five floors with no grade-level open spaces.
Datum: North American Datum of 1983
Acres Property ID: 184862
IC Data Access: -
Start Date: 05/01/2013
Redev Completion Date: -
Completed Date: 08/06/2014
Acres Cleaned Up: .2
Cleanup Funding: 80000
Cleanup Funding Source: EPA
Assessment Funding: -
Assessment Funding Source: -
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: -
Cleanup Funding Entity: Brownfields RLF Grant Funds Subgranted
Grant Type: Hazardous
Accomplishment Type: -
Accomplishment Count: -
Cooperative Agreement Number: 96295712
Start Date: -
Ownership Entity: Private
Completion Date: -
Current Owner: South Bronx Charter School for International Cultures & Arts
Did Owner Change: N
Cleanup Required: Y
Video Available: N
Photo Available: Y
Institutional Controls Required: N
IC Category Proprietary Controls: -
IC Cat. Info. Devices: -
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: N
State/tribal program date: -
State/tribal program ID: -
State/tribal NFA date: 08/06/2014
Air cleaned: -
Asbestos found: -
Asbestos cleaned: -
Controlled substance found: -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622 **DIST/DIR:** 0.162 ESE **ELEVATION:** 19 **MAP ID:** V151

NAME: SOUTH BRONX CHARTER SCHOOL
ADDRESS: 611 EAST 133RD STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 184862
ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

Controlled substance cleaned: -
Drinking water affected: -
Drinking water cleaned: -
Groundwater affected: Y
Groundwater cleaned: Y
Lead contaminant found: Y
Lead cleaned up: Y
No media affected: Not reported
Unknown media affected: -
Other cleaned up: -
Other metals found: Y
Other metals cleaned: Y
Other contaminants found: -
Other contams found description: -
PAHs found: -
PAHs cleaned up: -
PCBs found: Y
PCBs cleaned up: Y
Petro products found: -
Petro products cleaned: -
Sediments found: -
Sediments cleaned: -
Soil affected: Y
Soil cleaned up: Y
Surface water cleaned: -
VOCs found: Y
VOCs cleaned: Y
Cleanup other description: -
Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -
Past use residential acreage: -
Surface Water: -
Past use commercial acreage: .2
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: .2
Future use industrial acreage: -
Superfund Fed. landowner flag: -
Arsenic cleaned up: Y
Cadmium cleaned up: Y
Chromium cleaned up: Y
Copper cleaned up: -
Iron cleaned up: Y
mercury cleaned up: Y

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622 **DIST/DIR:** 0.162 ESE **ELEVATION:** 19 **MAP ID:** V151

NAME: SOUTH BRONX CHARTER SCHOOL
ADDRESS: 611 EAST 133RD STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 184862
ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: Y
Selenium cleaned up: -
SVOCs cleaned up: Y
Unknown clean up: -
Arsenic contaminant found: Y
Cadmium contaminant found: Y
Chromium contaminant found: Y
Copper contaminant found: -
Iron contaminant found: Y
Mercury contaminant found: Y
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: Y
Selenium contaminant found: -
SVOCs contaminant found: Y
Unknown contaminant found: -
Future Use: Multistory 0
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory Not reported
Property Description: The site is located in the Port Morris section in the Bronx. The site is 8,772-square feet and is bounded by Cypress Place to the north, East 133rd Street to the south, Cypress Place to the east, and Cypress Place to the west. Prior to development, the site was vacant but was most recently used as an adult entertainment establishment and contained a two-story 16,000 square foot building. The future use of the site consisted of complete demolition of the previous building for the construction of the new charter school. The new school covers the entire building lot. The total square footage of the school is 39,000 square feet and consists of five floors with no grade-level open spaces.
Below Poverty Number: 10517
Below Poverty Percent: 44.39
Meidan Income: 9315
Meidan Income Number: 17701
Meidan Income Percent: 74.72
Vacant Housing Number: 769
Vacant Housing Percent: 9.09
Unemployed Number: 1594
Unemployed Percent: 6.73

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622	DIST/DIR: 0.162 ESE	ELEVATION: 19	MAP ID: V151

NAME: SOUTH BRONX CHARTER SCHOOL ADDRESS: 611 EAST 133RD STREET BRONX, NY 10454	Rev: 06/10/2021 ID/Status: 184862 ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

Name: SOUTH BRONX CHARTER SCHOOL
 Address: 611 EAST 133RD STREET
 City,State,Zip: BRONX, NY 10454
 Recipient Name: City of New York
 Grant Type: BCRLF
 Property Number: -
 Parcel size: .2
 Latitude: 40.8030804
 Longitude: -73.9185966
 HCM Label: -
 Map Scale: -
 Point of Reference: -
 Highlights: Former Use: The site is located in the Port Morris section in the Bronx. The site is 8,772-square feet and is bounded by Cypress Place to the north, East 133rd Street to the south, Cypress Place to the east, and Cypress Place to the west. Prior to development, the site was vacant but was most recently used as an adult entertainment establishment and contained a two-story 16,000 square foot building. The future use of the site consisted of complete demolition of the previous building for the construction of the new charter school. The new school covers the entire building lot. The total square footage of the school is 39,000 square feet and consists of five floors with no grade-level open spaces.
 Datum: North American Datum of 1983
 Acres Property ID: 184862
 IC Data Access: -
 Start Date: 05/01/2013
 Redev Completion Date: -
 Completed Date: 08/06/2014
 Acres Cleaned Up: .2
 Cleanup Funding: 35292
 Cleanup Funding Source: Private funding
 Assessment Funding: -
 Assessment Funding Source: -
 Redevelopment Funding: -
 Redev. Funding Source: -
 Redev. Funding Entity Name: -
 Redevelopment Start Date: -
 Assessment Funding Entity: -
 Cleanup Funding Entity: Cost Share
 Grant Type: Hazardous
 Accomplishment Type: -
 Accomplishment Count: -
 Cooperative Agreement Number: 96295712
 Start Date: -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622 **DIST/DIR:** 0.162 ESE **ELEVATION:** 19 **MAP ID:** V151

NAME: SOUTH BRONX CHARTER SCHOOL

Rev: 06/10/2021

ADDRESS: 611 EAST 133RD STREET
BRONX, NY 10454

ID/Status: 184862

ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

Ownership Entity: Private

Completion Date: -

Current Owner: South Bronx Charter School for International Cultures & Arts

Did Owner Change: N

Cleanup Required: Y

Video Available: N

Photo Available: Y

Institutional Controls Required: N

IC Category Proprietary Controls: -

IC Cat. Info. Devices: -

IC Cat. Gov. Controls: -

IC Cat. Enforcement Permit Tools: -

IC in place date: -

IC in place: N

State/tribal program date: -

State/tribal program ID: -

State/tribal NFA date: 08/06/2014

Air cleaned: -

Asbestos found: -

Asbestos cleaned: -

Controlled substance found: -

Controlled substance cleaned: -

Drinking water affected: -

Drinking water cleaned: -

Groundwater affected: Y

Groundwater cleaned: Y

Lead contaminant found: Y

Lead cleaned up: Y

No media affected: Not reported

Unknown media affected: -

Other cleaned up: -

Other metals found: Y

Other metals cleaned: Y

Other contaminants found: -

Other contams found description: -

PAHs found: -

PAHs cleaned up: -

PCBs found: Y

PCBs cleaned up: Y

Petro products found: -

Petro products cleaned: -

Sediments found: -

Sediments cleaned: -

Soil affected: Y

Soil cleaned up: Y

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622 **DIST/DIR:** 0.162 ESE **ELEVATION:** 19 **MAP ID:** V151

NAME: SOUTH BRONX CHARTER SCHOOL
ADDRESS: 611 EAST 133RD STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 184862
ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

Surface water cleaned: -
VOCs found: Y
VOCs cleaned: Y
Cleanup other description: -
Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -
Past use residential acreage: -
Surface Water: -
Past use commercial acreage: .2
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: .2
Future use industrial acreage: -
Superfund Fed. landowner flag: -
Arsenic cleaned up: Y
Cadmium cleaned up: Y
Chromium cleaned up: Y
Copper cleaned up: -
Iron cleaned up: Y
mercury cleaned up: Y
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: Y
Selenium cleaned up: -
SVOCs cleaned up: Y
Unknown clean up: -
Arsenic contaminant found: Y
Cadmium contaminant found: Y
Chromium contaminant found: Y
Copper contaminant found: -
Iron contaminant found: Y
Mercury contaminant found: Y
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: Y
Selenium contaminant found: -
SVOCs contaminant found: Y
Unknown contaminant found: -
Future Use: Multistory 0
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622 **DIST/DIR:** 0.162 ESE **ELEVATION:** 19 **MAP ID:** V151

NAME: SOUTH BRONX CHARTER SCHOOL

Rev: 06/10/2021

ADDRESS: 611 EAST 133RD STREET
BRONX, NY 10454

ID/Status: 184862

ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

Past Use: Multistory Not reported

Property Description: The site is located in the Port Morris section in the Bronx. The site is 8,772-square feet and is bounded by Cypress Place to the north, East 133rd Street to the south, Cypress Place to the east, and Cypress Place to the west. Prior to development, the site was vacant but was most recently used as an adult entertainment establishment and contained a two-story 16,000 square foot building. The future use of the site consisted of complete demolition of the previous building for the construction of the new charter school. The new school covers the entire building lot. The total square footage of the school is 39,000 square feet and consists of five floors with no grade-level open spaces.

Below Poverty Number: 10517

Below Poverty Percent: 44.39

Median Income: 9315

Median Income Number: 17701

Median Income Percent: 74.72

Vacant Housing Number: 769

Vacant Housing Percent: 9.09

Unemployed Number: 1594

Unemployed Percent: 6.73

Name: SOUTH BRONX CHARTER SCHOOL

Address: 611 EAST 133RD STREET

City,State,Zip: BRONX, NY 10454

Recipient Name: City of New York

Grant Type: BCRLF

Property Number: -

Parcel size: .2

Latitude: 40.8030804

Longitude: -73.9185966

HCM Label: -

Map Scale: -

Point of Reference: -

Highlights: Former Use: The site is located in the Port Morris section in the Bronx. The site is 8,772-square feet and is bounded by Cypress Place to the north, East 133rd Street to the south, Cypress Place to the east, and Cypress Place to the west. Prior to development, the site was vacant but was most recently used as an adult entertainment establishment and contained a two-story 16,000 square foot building. The future use of the site consisted of complete demolition of the previous building for the construction of the new charter school. The new school covers the entire building lot. The total square footage of the school is 39,000 square feet and consists of five floors with no grade-level open spaces.

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622 **DIST/DIR:** 0.162 ESE **ELEVATION:** 19 **MAP ID:** V151

NAME: SOUTH BRONX CHARTER SCHOOL

Rev: 06/10/2021

ADDRESS: 611 EAST 133RD STREET
BRONX, NY 10454

ID/Status: 184862

ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

Datum: North American Datum of 1983

Acres Property ID: 184862

IC Data Access: -

Start Date: 05/01/2013

Redev Completion Date: -

Completed Date: 08/06/2014

Acres Cleaned Up: .2

Cleanup Funding: 80000

Cleanup Funding Source: EPA

Assessment Funding: -

Assessment Funding Source: -

Redevelopment Funding: -

Redev. Funding Source: -

Redev. Funding Entity Name: -

Redevelopment Start Date: -

Assessment Funding Entity: -

Cleanup Funding Entity: Brownfields RLF Grant Funds Subgranted

Grant Type: Hazardous

Accomplishment Type: -

Accomplishment Count: -

Cooperative Agreement Number: 96295712

Start Date: -

Ownership Entity: Private

Completion Date: -

Current Owner: South Bronx Charter School for International Cultures & Arts

Did Owner Change: N

Cleanup Required: Y

Video Available: N

Photo Available: Y

Institutional Controls Required: N

IC Category Proprietary Controls: -

IC Cat. Info. Devices: -

IC Cat. Gov. Controls: -

IC Cat. Enforcement Permit Tools: -

IC in place date: -

IC in place: N

State/tribal program date: -

State/tribal program ID: -

State/tribal NFA date: 08/06/2014

Air cleaned: -

Asbestos found: -

Asbestos cleaned: -

Controlled substance found: -

Controlled substance cleaned: -

Drinking water affected: -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622 **DIST/DIR:** 0.162 ESE **ELEVATION:** 19 **MAP ID:** V151

NAME: SOUTH BRONX CHARTER SCHOOL
ADDRESS: 611 EAST 133RD STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 184862
ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

Drinking water cleaned: -
Groundwater affected: Y
Groundwater cleaned: Y
Lead contaminant found: Y
Lead cleaned up: Y
No media affected: Not reported
Unknown media affected: -
Other cleaned up: -
Other metals found: Y
Other metals cleaned: Y
Other contaminants found: -
Other contams found description: -
PAHs found: -
PAHs cleaned up: -
PCBs found: Y
PCBs cleaned up: Y
Petro products found: -
Petro products cleaned: -
Sediments found: -
Sediments cleaned: -
Soil affected: Y
Soil cleaned up: Y
Surface water cleaned: -
VOCs found: Y
VOCs cleaned: Y
Cleanup other description: -
Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -
Past use residential acreage: -
Surface Water: -
Past use commercial acreage: .2
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: .2
Future use industrial acreage: -
Superfund Fed. landowner flag: -
Arsenic cleaned up: Y
Cadmium cleaned up: Y
Chromium cleaned up: Y
Copper cleaned up: -
Iron cleaned up: Y
mercury cleaned up: Y
Nickel Cleaned Up: -
No clean up: -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1018119622 **DIST/DIR:** 0.162 ESE **ELEVATION:** 19 **MAP ID:** V151

NAME: SOUTH BRONX CHARTER SCHOOL

Rev: 06/10/2021

ADDRESS: 611 EAST 133RD STREET
BRONX, NY 10454

ID/Status: 184862

ID/Status: 08/06/2014

SOURCE: US Environmental Protection Agency

Pesticides cleaned up: Y
Selenium cleaned up: -
SVOCs cleaned up: Y
Unknown clean up: -
Arsenic contaminant found: Y
Cadmium contaminant found: Y
Chromium contaminant found: Y
Copper contaminant found: -
Iron contaminant found: Y
Mercury contaminant found: Y
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: Y
Selenium contaminant found: -
SVOCs contaminant found: Y
Unknown contaminant found: -
Future Use: Multistory 0
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory Not reported

Property Description: The site is located in the Port Morris section in the Bronx. The site is 8,772-square feet and is bounded by Cypress Place to the north, East 133rd Street to the south, Cypress Place to the east, and Cypress Place to the west. Prior to development, the site was vacant but was most recently used as an adult entertainment establishment and contained a two-story 16,000 square foot building. The future use of the site consisted of complete demolition of the previous building for the construction of the new charter school. The new school covers the entire building lot. The total square footage of the school is 39,000 square feet and consists of five floors with no grade-level open spaces.

Below Poverty Number: 10517
Below Poverty Percent: 44.39
Meidan Income: 9315
Meidan Income Number: 17701
Meidan Income Percent: 74.72
Vacant Housing Number: 769
Vacant Housing Percent: 9.09
Unemployed Number: 1594
Unemployed Percent: 6.73

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

VCP

EDR ID: S125317306 **DIST/DIR:** 0.172 ESE **ELEVATION:** 19 **MAP ID:** V152

NAME: SOUTH BRONX CHARTER SCHOOL - DOB JOB NO. NB - 220290593 08/09/2021

ADDRESS: 164 BRUCKNER BLVD
NEW YORK CITY, NY

SOURCE: NY Department of Environmental Conservation

VCP NYC:

Project ID: 13TMP0408X, 13RHAZ408X, 13CVCP132X

Name: SOUTH BRONX CHARTER SCHOOL - DOB JOB NO. NB - 220290593

Address: 164 BRUCKNER BLVD

City,State,Zip: NEW YORK CITY, NY

Borough: Bronx

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

SPDES

EDR ID: S122256970 **DIST/DIR:** 0.175 South **ELEVATION:** 2 **MAP ID:** 153

NAME: NYC DDC RANDALLS ISLAND WATER AND GAS MAINS HED-568 **EXP:** 07/27/2021
ADDRESS: BRONX TO RANDALLS ISLAND **ID/Status:** NY0276731
NEW YORK, NY

SOURCE: NY Department of Environmental Conservation

SPDES:

Name: NYC DDC RANDALLS ISLAND WATER AND GAS MAINS HED-568

Address: BRONX TO RANDALLS ISLAND

City,State,Zip: NEW YORK, NY

Permit Number: NY0276731

State-Region: 2

Expiration Date: 05/31/2021

Current Major Minor Status: Not reported

Primary Facility SIC Code: 1794

State Water Body Name: Not reported

Limit Set Status Flag: Not reported

Total Actual Average Flow(MGD): 6.60000000

Total App Design Flow(MGD): Not reported

UDF1: Not reported

Lat/Long: 40.800903 / 73.9218993

DMR Cognizant Official: Not reported

UDF2: Not reported

UDF3: Not reported

FIPS County Code: Not reported

Non-Gov Permit Affiliation Type Desc: Not reported

Non-Gov Permit Org Formal Name: NYC DEPT OF DESIGN & CONSTRUCTION

Non-Gov Permit Street Address: 30-30 THOMSON AVE FL 5

Non-Gov Permit Supplemental Location: Not reported

Non-Gov Permit City: LONG ISLAND CITY

Non-Gov Permit State Code: NY

Non-Gov Permit Zip Code: 11101

Non-Gov Facility Affiliation Type Desc: Not reported

Non-Gov Facility Org Formal Name: Not reported

Non-Gov Facility Street Address: Not reported

Non-Gov Facility Supplemental Location: Not reported

Non-Gov Facility City: Not reported

Non-Gov Facility State Code: Not reported

Non-Gov Facility Zip Code: Not reported

State Water Body: Not reported

Region Permit Processed: Not reported

Dow Discharge Class Code: Not reported

SPDES Class Description: Not reported

Affiliation Type Description: Not reported

Name: Not reported

Contacts Title: Not reported

Contacts Email: Not reported

NOI Submission Date: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S102149612 **DIST/DIR:** 0.192 NE **ELEVATION:** 27 **MAP ID:** W154

NAME: MILLBROOK -NYCHA

Rev: 08/09/2021

ADDRESS: 160 SAINT ANNS AVENUE
BRONX, NY
BRONX

ID/Status: 9203924 / 2006-01-18

ID/Status: 9212748 / 1993-02-11

ID/Status: 95620

ID/Status: 106441

ID/Status: 1992-07-06

SOURCE: NY Department of Environmental Conservation

LTANKS:

Name: MILLBROOK -NYCHA

Address: 160 SAINT ANNS AVENUE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9203924 / 2006-01-18

Facility ID: 9203924

Site ID: 95620

Spill Date: 1992-07-06

Spill Cause: Tank Failure

Spill Source: Institutional, Educational, Gov., Other

Spill Class: B3

Cleanup Ceased: Not reported

SWIS: 0301

Investigator: SWKRASZE

Referred To: Not reported

Reported to Dept: 1992-07-06

CID: Not reported

Water Affected: Not reported

Spill Notifier: Responsible Party

Last Inspection: Not reported

Recommended Penalty: False

Meets Standard: False

UST Involvement: False

Remediation Phase: 0

Date Entered In Computer: 1992-07-07

Spill Record Last Update: 2006-01-18

Spiller Name: Not reported

Spiller Company: NYCHA

Spiller Address: Not reported

Spiller County: 001

Spiller Contact: Not reported

Spiller Phone: Not reported

Spiller Extention: Not reported

DEC Region: 2

DER Facility ID: 252917

DEC Memo: "01/18/06: This spill transferred from J.Kolleeny to S.Kraszewski.

This spill closed to consolidate with open spill #9706421. - SK"

Remarks: "EXCAVATING RETURN LINE DUE TO LOSS OF PRODUCT ON INVENTORY-TANK #1
ISOLATED-FOUND CONTAMINATED SOIL-WINSTON TO PICK UP AND DISPOSE. WILL
REPAIR OR REPLACE RETURN LINE."

All TTF:

Facility ID: 9203924

Spill Number: 9203924

Spill Tank Test: 1540188

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S102149612 **DIST/DIR:** 0.192 NE **ELEVATION:** 27 **MAP ID:** W154

NAME: MILLBROOK -NYCHA

Rev: 08/09/2021

ADDRESS: 160 SAINT ANNS AVENUE
BRONX, NY
BRONX

ID/Status: 9203924 / 2006-01-18

ID/Status: 9212748 / 1993-02-11

ID/Status: 95620

ID/Status: 106441

ID/Status: 1992-07-06

SOURCE: NY Department of Environmental Conservation

Site ID: 95620

Tank Number: Not reported

Tank Size: 0

Material: 0002

EPA UST: Not reported

UST: Not reported

Cause: Not reported

Source: Not reported

Test Method: 00

Test Method 2: Unknown

Leak Rate: .00

Gross Fail: Not reported

Modified By: Spills

Last Modified Date: Not reported

All Materials:

Site ID: 95620

Operable Unit ID: 967724

Operable Unit: 01

Material ID: 567466

Material Code: 0002A

Material Name: #4 fuel oil

Case No.: Not reported

Material FA: Petroleum

Quantity: -1.00

Units: L

Recovered: .00

Oxygenate: Not reported

Name: MILLBROOK -NYCHA

Address: 160 SAINT ANNS AVENUE

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 9212748 / 1993-02-11

Facility ID: 9212748

Site ID: 106441

Spill Date: 1993-02-11

Spill Cause: Tank Overfill

Spill Source: Institutional, Educational, Gov., Other

Spill Class: C4

Cleanup Ceased: 1993-02-11

SWIS: 0301

Investigator: HEALY

Referred To: Not reported

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S102149612 **DIST/DIR:** 0.192 NE **ELEVATION:** 27 **MAP ID:** W154

NAME: MILLBROOK -NYCHA

Rev: 08/09/2021

ADDRESS: 160 SAINT ANNS AVENUE
BRONX, NY
BRONX

ID/Status: 9203924 / 2006-01-18

ID/Status: 9212748 / 1993-02-11

ID/Status: 95620

ID/Status: 106441

ID/Status: 1992-07-06

SOURCE: NY Department of Environmental Conservation

Reported to Dept: 1993-02-11

CID: Not reported

Water Affected: Not reported

Spill Notifier: Responsible Party

Last Inspection: Not reported

Recommended Penalty: False

Meets Standard: True

UST Involvement: False

Remediation Phase: 0

Date Entered In Computer: 1993-02-11

Spill Record Last Update: 2005-12-08

Spiller Name: Not reported

Spiller Company: NYC HOUSING

Spiller Address: Not reported

Spiller County: 001

Spiller Contact: Not reported

Spiller Phone: Not reported

Spiller Extention: Not reported

DEC Region: 2

DER Facility ID: 252917

DEC Memo: ""

Remarks: "SPILL ON SIDE WALK-NO DRAINS CLEANUP IN PROGRESS-POSSIBLE SPILL IN
GRASS ALSO-CALLED AND CONFIRMED CLEANUP"

All TTF:

Facility ID: 9212748

Spill Number: 9212748

Spill Tank Test: 1541162

Site ID: 106441

Tank Number: Not reported

Tank Size: 0

Material: 0003

EPA UST: Not reported

UST: Not reported

Cause: 02

Source: Not reported

Test Method: 00

Test Method 2: Unknown

Leak Rate: .00

Gross Fail: Not reported

Modified By: Spills

Last Modified Date: Not reported

All Materials:

Site ID: 106441

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S102149612 **DIST/DIR:** 0.192 NE **ELEVATION:** 27 **MAP ID:** W154

NAME: MILLBROOK -NYCHA

Rev: 08/09/2021

ADDRESS: 160 SAINT ANNS AVENUE
BRONX, NY
BRONX

ID/Status: 9203924 / 2006-01-18

ID/Status: 9212748 / 1993-02-11

ID/Status: 95620

ID/Status: 106441

SOURCE: NY Department of Environmental Conservation

ID/Status: 1992-07-06

Operable Unit ID: 977149

Operable Unit: 01

Material ID: 402580

Material Code: 0003A

Material Name: #6 fuel oil

Case No.: Not reported

Material FA: Petroleum

Quantity: 50.00

Units: G

Recovered: .00

Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

VCP

EDR ID: S125316863 **DIST/DIR:** 0.192 NE **ELEVATION:** 27 **MAP ID:** W155

NAME: 160 ST. ANN'S AVENUE - MILLBROOK HOUSES (NYCHA/HPD) **Rev:** 08/09/2021

ADDRESS: 160 ST. ANN'S AVENUE
NEW YORK CITY, NY

SOURCE: NY Department of Environmental Conservation

VCP NYC:

Project ID: 17TMP0044X, 17TEMP001X, 17CVCP041X

Name: 160 ST. ANN'S AVENUE - MILLBROOK HOUSES (NYCHA/HPD)

Address: 160 ST. ANN'S AVENUE

City,State,Zip: NEW YORK CITY, NY

Borough: Bronx

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

SPDES

EDR ID: S122263456 **DIST/DIR:** 0.200 SSE **ELEVATION:** 13 **MAP ID:** 156

NAME: FRESH DIRECT

Rev: 07/27/2021

ADDRESS: ST. ANNS AVENUE
BRONX, NY 10454
BRONX

ID/Status: NYR10X505

SOURCE: NY Department of Environmental Conservation

SPDES:

Name: FRESH DIRECT

Address: ST. ANNS AVENUE

City,State,Zip: BRONX, NY 10454-4426

Permit Number: NYR10X505

State-Region: 2

Expiration Date: Not reported

Current Major Minor Status: Not reported

Primary Facility SIC Code: Not reported

State Water Body Name: Not reported

Limit Set Status Flag: Not reported

Total Actual Average Flow(MGD): Not reported

Total App Design Flow(MGD): Not reported

UDF1: Not reported

Lat/Long: 591146 / 4517207

DMR Cognizant Official: Not reported

UDF2: Not reported

UDF3: Not reported

FIPS County Code: Not reported

Non-Gov Permit Affiliation Type Desc: Not reported

Non-Gov Permit Org Formal Name: Not reported

Non-Gov Permit Street Address: Not reported

Non-Gov Permit Supplemental Location: Not reported

Non-Gov Permit City: Not reported

Non-Gov Permit State Code: Not reported

Non-Gov Permit Zip Code: Not reported

Non-Gov Facility Affiliation Type Desc: Not reported

Non-Gov Facility Org Formal Name: Not reported

Non-Gov Facility Street Address: Not reported

Non-Gov Facility Supplemental Location: Not reported

Non-Gov Facility City: Not reported

Non-Gov Facility State Code: Not reported

Non-Gov Facility Zip Code: Not reported

State Water Body: Not reported

Region Permit Processed: Not reported

Dow Discharge Class Code: Not reported

SPDES Class Description: Construction

Affiliation Type Description: Not reported

Name: LANGAN ENGINEERING

Contacts Title: Not reported

Contacts Email: RBURROW@LANGAN.COM

NOI Submission Date: 12/19/2013

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

SPDES

EDR ID: S123265191 **DIST/DIR:** 0.209 SSW **ELEVATION:** 7 **MAP ID:** 157

NAME: BRONX SHORE FIELDS

Rev: 07/27/2021

ADDRESS: RANDALLS ISLAND
NEW YORK, NY 10035
NEW YORK

ID/Status: NYR10W824

SOURCE: NY Department of Environmental Conservation

SPDES:

Name: BRONX SHORE FIELDS
Address: RANDALLS ISLAND
City,State,Zip: NEW YORK, NY 10035-
Permit Number: NYR10W824
State-Region: 2
Expiration Date: Not reported
Current Major Minor Status: Not reported
Primary Facility SIC Code: Not reported
State Water Body Name: Not reported
Limit Set Status Flag: Not reported
Total Actual Average Flow(MGD): Not reported
Total App Design Flow(MGD): Not reported
UDF1: Not reported
Lat/Long: 590886 / 4517174
DMR Cognizant Official: Not reported
UDF2: Not reported
UDF3: Not reported
FIPS County Code: Not reported

Non-Gov Permit Affiliation Type Desc: Not reported
Non-Gov Permit Org Formal Name: Not reported
Non-Gov Permit Street Address: Not reported
Non-Gov Permit Supplemental Location: Not reported
Non-Gov Permit City: Not reported
Non-Gov Permit State Code: Not reported
Non-Gov Permit Zip Code: Not reported
Non-Gov Facility Affiliation Type Desc: Not reported
Non-Gov Facility Org Formal Name: Not reported
Non-Gov Facility Street Address: Not reported
Non-Gov Facility Supplemental Location: Not reported
Non-Gov Facility City: Not reported
Non-Gov Facility State Code: Not reported
Non-Gov Facility Zip Code: Not reported
State Water Body: Not reported
Region Permit Processed: Not reported
Dow Discharge Class Code: Not reported
SPDES Class Description: Construction
Affiliation Type Description: Not reported
Name: HDR
Contacts Title: Not reported
Contacts Email: Not reported
NOI Submission Date: 06/11/2013

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S107523324 **DIST/DIR:** 0.212 NW **ELEVATION:** 32 **MAP ID:** X158

NAME: BUSINESS

Rev: 08/09/2021

ADDRESS: 91 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 0511553 / 2006-03-06

ID/Status: 357736

ID/Status: 2006-01-05

SOURCE: NY Department of Environmental Conservation

LTANKS:

Name: BUSINESS

Address: 91 BRUCKNER BLVD

City,State,Zip: BRONX, NY

Spill Number/Closed Date: 0511553 / 2006-03-06

Facility ID: 0511553

Site ID: 357736

Spill Date: 2006-01-05

Spill Cause: Tank Failure

Spill Source: Institutional, Educational, Gov., Other

Spill Class: C4

Cleanup Ceased: Not reported

SWIS: 0301

Investigator: Con Ed Unassigned

Referred To: Not reported

Reported to Dept: 2006-01-06

CID: 444

Water Affected: Not reported

Spill Notifier: Other

Last Inspection: Not reported

Recommended Penalty: False

Meets Standard: False

UST Involvement: False

Remediation Phase: 0

Date Entered In Computer: 2006-01-06

Spill Record Last Update: 2006-03-06

Spiller Name: JEFFREY FIEDLER

Spiller Company: BUSINESS

Spiller Address: 91 BRUCKNER BLVD

Spiller County: 001

Spiller Contact: JEFFREY FIEDLER

Spiller Phone: (718) 993-4100

Spiller Extention: Not reported

DEC Region: 2

DER Facility ID: 307781

DEC Memo: "01/06/06. Feroze. TTF is send to: Jeffrey Fielder Fielder Roofing,

91 Bruckner Blvd, Bronx, NY 10454 03/06/06 Feroze talked with Ms.

Agata 718-993-4100. She told me that she has sent all documents to

DEC. In documents I found a certificate given by Absolute Tank

Testing lcc. (203-876-7430) taht there was no detectable leaks in the

tank. They submitted me the tank test result and the result is passed.

The spill is closed."

Remarks: "PBS No: 2-605282 1500 GALLON TANK :"

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S107523324 **DIST/DIR:** 0.212 NW **ELEVATION:** 32 **MAP ID:** X158

NAME: BUSINESS

Rev: 08/09/2021

ADDRESS: 91 BRUCKNER BLVD
BRONX, NY
BRONX

ID/Status: 0511553 / 2006-03-06
ID/Status: 357736
ID/Status: 2006-01-05

SOURCE: NY Department of Environmental Conservation

All Materials:
Site ID: 357736
Operable Unit ID: 1115003
Operable Unit: 01
Material ID: 2105065
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S110611368	DIST/DIR: 0.212 NW	ELEVATION: 32	MAP ID: X159

NAME: FIEDLER COMPANY INC.

Rev: 08/09/2021

ADDRESS: 91 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 1008706 / 2019-01-07
ID/Status: 442210
ID/Status: 2010-11-18

SOURCE: NY Department of Environmental Conservation

LTANKS:

Name: FIEDLER COMPANY INC.
Address: 91 BRUCKNER BLVD
City,State,Zip: BRONX, NY 10454
Spill Number/Closed Date: 1008706 / 2019-01-07
Facility ID: 1008706
Site ID: 442210
Spill Date: 2010-11-18
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: C4
Cleanup Ceased: Not reported
SWIS: 0301
Investigator: MSHOQUE
Referred To: Not reported
Reported to Dept: 2010-11-18
CID: Not reported
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 2010-11-18
Spill Record Last Update: 2019-01-07
Spiller Name: Not reported
Spiller Company: TANK TEST FAILURE
Spiller Address: Not reported
Spiller County: 999
Spiller Contact: JEFFEREY FIEDLER
Spiller Phone: (718) 993-4100
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 397247
DEC Memo: "TTF Letter sent to PBS Address - See eDocs 07/16/13 - Spill Case is transferred from Brian Falvey (PBS Unit) to V. Brevdo (Section B) as per DER Region 2 decision - Tank Test Failure Spill Case. VB 08-03-2018 As per Remediation Section B Chief Vadim Brevdo, this spill case is reassigned from Vadim Brevdo to MD. S. Hoque as project manager effective on August 3, 2018. -MDH 10/3/2018-M.Hoque: Spoke to Ms.Carrie Matthews of ATS Environmental and requested to sent the TTF report to the Department. She sent the tank reliability test report on the same day. Brief summary of the report: -ATS Env. conducted the

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S110611368 **DIST/DIR:** 0.212 NW **ELEVATION:** 32 **MAP ID:** X159

NAME: FIEDLER COMPANY INC.

Rev: 08/09/2021

ADDRESS: 91 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 1008706 / 2019-01-07

ID/Status: 442210

ID/Status: 2010-11-18

SOURCE: NY Department of Environmental Conservation

S.T.E.P.S corrosion test(tank reliability test) to assess the corrosive state of the storage tank on October 5,2017. Testing detected unacceptable corrosion levels between the tank and soil, which indicated a high probability that a leak may occurred or existed in the tank system. Based on the corrosion readings, the tank appears to be at the end of its serviceable life. The report strongly recommended to remove the tank. ATS were not able to test with a high corrosion level.MDH 11/26/2018-M.Hoque: Spoke to Jeffery Fiedler(RP) and discussed the open spill case. He said that the UST abandoned and replaced with a new two 275-gallon AST ears ago. I request him to send the tank abandonment documents/report to the Department. MDH 11/27/2018-M.Hoque: Tank abandonment report and invoice received on 11/27/2018. The report is being reviewed. MDH 12/10/2018-M.Hoque: Received spills closure petition. MDH 01/07/2019-M.Hoque: The site is occupied by a one-story building. In November 2010, a spill was reported when a 1,500-gallon #2 fuel oil UST failed the tightness test. The RP s contractor, Advanced Tank Services (ATS), conducted the tank tightness test in December 2010. The tank tightness test was passed. In October 2017, ATS conducted the S.T.E.P.S corrosion test (tank reliability test) to assess corrosive state of the tank. An unacceptable corrosion was detected between the tank and soil, which indicated a high probability that a leak might occurred or existed in the tank system. Based on the corrosion readings, ATS determined that the tank was at the end of its serviceable life and strongly recommended to remove/or abandon of the tank in place. On November 26, 2018, the Department contacted the RP and requested to submit an updated status report for the historic open spills case. The Department received the tank abandonment report along with spill closure petition on December 6, 2018. The report stated that the 1,500-gallon UST replaced with two 275-gallon above ground storage tank (AST), and the existing tank was abandoned in-place in accordance with appropriate rules and regulations on December 6, 2017. Prior to abandonment, the tank was purged, cut and cleaned, all contents were disposed off-site, and finally abandoned tank filled with sand and concrete. Subsequently, soil samples were collected for laboratory analysis. Collected samples did not exceed NYSDEC soil cleanup standards. No contamination is present at the site and the site no longer poses threat to human health and the environment for current building occupants. The Department reviewed tank abandonment report and concluded that the spill case closure is appropriate at this time. The Department closed spill case on January 7, 2019."

Remarks: "retest pending repair"

All Materials:

Site ID: 442210

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

LTANKS

EDR ID: S110611368 **DIST/DIR:** 0.212 NW **ELEVATION:** 32 **MAP ID:** X159

NAME: FIEDLER COMPANY INC.

Rev: 08/09/2021

ADDRESS: 91 BRUCKNER BLVD
BRONX, NY 10454
BRONX

ID/Status: 1008706 / 2019-01-07
ID/Status: 442210
ID/Status: 2010-11-18

SOURCE: NY Department of Environmental Conservation

Operable Unit ID: 1192735
Operable Unit: 01
Material ID: 2188070
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Oxygenate: Not reported

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

CBS

EDR ID: S108410839 **DIST/DIR:** 0.216 North **ELEVATION:** 31 **MAP ID:** 160

NAME: ARISTY AUTO REPAIR & WRECKERS

Rev: 06/21/2021

ADDRESS: 136 ST 137 ST.
BRONX, NY 10454
BRONX

ID/Status: Inactive
ID/Status: 2-000442

SOURCE: NY Department of Environmental Conservation

CBS:

Name: ARISTY AUTO REPAIR & WRECKERS

Address: 136 ST 137 ST.

City,State,Zip: BRONX, NY 10454

CBS Number: 2-000442

Program Type: CBS

Facility Status: Inactive

Expiration Date: Not reported

Dec Region: 2

UTMX: 591030.70855

UTMY: 4517884.76393

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

SPDES

EDR ID: S123258170	DIST/DIR: 0.223 SSW	ELEVATION: 8	MAP ID: 161

NAME: RANDALL'S ISLAND WATER PARK

Rev: 07/27/2021

ADDRESS:

ID/Status: NYR10L918

NEW YORK, NY 10001

SOURCE: NY Department of Environmental Conservation

SPDES:

Name: RANDALL'S ISLAND WATER PARK

Address: Not reported

City,State,Zip: NEW YORK, NY 10001-

Permit Number: NYR10L918

State-Region: Not reported

Expiration Date: Not reported

Current Major Minor Status: Not reported

Primary Facility SIC Code: Not reported

State Water Body Name: Not reported

Limit Set Status Flag: Not reported

Total Actual Average Flow(MGD): Not reported

Total App Design Flow(MGD): Not reported

UDF1: Not reported

Lat/Long: 590820 / 4517180

DMR Cognizant Official: Not reported

UDF2: Not reported

UDF3: Not reported

FIPS County Code: Not reported

Non-Gov Permit Affiliation Type Desc: Not reported

Non-Gov Permit Org Formal Name: Not reported

Non-Gov Permit Street Address: Not reported

Non-Gov Permit Supplemental Location: Not reported

Non-Gov Permit City: Not reported

Non-Gov Permit State Code: Not reported

Non-Gov Permit Zip Code: Not reported

Non-Gov Facility Affiliation Type Desc: Not reported

Non-Gov Facility Org Formal Name: Not reported

Non-Gov Facility Street Address: Not reported

Non-Gov Facility Supplemental Location: Not reported

Non-Gov Facility City: Not reported

Non-Gov Facility State Code: Not reported

Non-Gov Facility Zip Code: Not reported

State Water Body: Not reported

Region Permit Processed: Not reported

Dow Discharge Class Code: Not reported

SPDES Class Description: Construction

Affiliation Type Description: Not reported

Name: PHILIP HABIB & ASSOCIATES

Contacts Title: Not reported

Contacts Email: Not reported

NOI Submission Date: 11/21/2006

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1025442481	DIST/DIR: 0.236 NE	ELEVATION: 29	MAP ID: 162

NAME: MILL BROOK TERRACE ADDRESS: 570 E. 137TH STREET BRONX, NY 10454	Rev: 06/10/2021 ID/Status: 237104 ID/Status: -

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Name: MILL BROOK TERRACE
 Address: 570 E. 137TH STREET
 City,State,Zip: BRONX, NY 10454
 Recipient Name: City of New York
 Grant Type: BCRLF
 Property Number: -
 Parcel size: .73
 Latitude: 40.8054877
 Longitude: -73.91793239999998
 HCM Label: -
 Map Scale: -
 Point of Reference: -
 Highlights: -
 Datum: -
 Acres Property ID: 237104
 IC Data Access: -
 Start Date: 01/01/2017
 Redev Completion Date: -
 Completed Date: -
 Acres Cleaned Up: .73
 Cleanup Funding: 50000
 Cleanup Funding Source: Developer
 Assessment Funding: -
 Assessment Funding Source: -
 Redevelopment Funding: -
 Redev. Funding Source: -
 Redev. Funding Entity Name: -
 Redevelopment Start Date: -
 Assessment Funding Entity: -
 Cleanup Funding Entity: Cost Share
 Grant Type: Hazardous
 Accomplishment Type: -
 Accomplishment Count: -
 Cooperative Agreement Number: 96287213
 Start Date: -
 Ownership Entity: -
 Completion Date: -
 Current Owner: -
 Did Owner Change: -
 Cleanup Required: Y
 Video Available: -
 Photo Available: -
 Institutional Controls Required: U

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1025442481 **DIST/DIR:** 0.236 NE **ELEVATION:** 29 **MAP ID:** 162

NAME: MILL BROOK TERRACE
ADDRESS: 570 E. 137TH STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 237104
ID/Status: -

SOURCE: US Environmental Protection Agency

IC Category Proprietary Controls: -
IC Cat. Info. Devices: -
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: -
State/tribal program date: -
State/tribal program ID: -
State/tribal NFA date: -
Air cleaned: -
Asbestos found: -
Asbestos cleaned: -
Controlled substance found: -
Controlled substance cleaned: -
Drinking water affected: -
Drinking water cleaned: -
Groundwater affected: Y
Groundwater cleaned: Y
Lead contaminant found: Y
Lead cleaned up: Y
No media affected: Not reported
Unknown media affected: -
Other cleaned up: -
Other metals found: Y
Other metals cleaned: Y
Other contaminants found: -
Other contaminants found description: -
PAHs found: -
PAHs cleaned up: -
PCBs found: -
PCBs cleaned up: -
Petro products found: -
Petro products cleaned: -
Sediments found: -
Sediments cleaned: -
Soil affected: Y
Soil cleaned up: Y
Surface water cleaned: -
VOCs found: -
VOCs cleaned: -
Cleanup other description: -
Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -
Past use residential acreage: -
Surface Water: -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1025442481 **DIST/DIR:** 0.236 NE **ELEVATION:** 29 **MAP ID:** 162

NAME: MILL BROOK TERRACE
ADDRESS: 570 E. 137TH STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 237104
ID/Status: -

SOURCE: US Environmental Protection Agency

Past use commercial acreage: -
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: -
Future use industrial acreage: -
Superfund Fed. landowner flag: -
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: Y
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: Y
Selenium cleaned up: -
SVOCs cleaned up: Y
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: Y
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: Y
Selenium contaminant found: -
SVOCs contaminant found: Y
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory Not reported
Property Description: -
Below Poverty Number: 14892
Below Poverty Percent: 43.23
Meidan Income: 9368
Meidan Income Number: 25191
Meidan Income Percent: 73.12
Vacant Housing Number: 1160

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1025442481	DIST/DIR: 0.236 NE	ELEVATION: 29	MAP ID: 162

NAME: MILL BROOK TERRACE ADDRESS: 570 E. 137TH STREET BRONX, NY 10454	Rev: 06/10/2021 ID/Status: 237104 ID/Status: -

SOURCE: US Environmental Protection Agency

Vacant Housing Percent: 9.56
 Unemployed Number: 2168
 Unemployed Percent: 6.29

Name: MILL BROOK TERRACE
 Address: 570 E. 137TH STREET
 City,State,Zip: BRONX, NY 10454
 Recipient Name: City of New York
 Grant Type: BCRLF
 Property Number: -
 Parcel size: .73
 Latitude: 40.8054877
 Longitude: -73.91793239999998
 HCM Label: -
 Map Scale: -
 Point of Reference: -
 Highlights: -
 Datum: -
 Acres Property ID: 237104
 IC Data Access: -
 Start Date: 01/01/2017
 Redev Completion Date: -
 Completed Date: -
 Acres Cleaned Up: .73
 Cleanup Funding: 200000
 Cleanup Funding Source: EPA
 Assessment Funding: -
 Assessment Funding Source: -
 Redevelopment Funding: -
 Redev. Funding Source: -
 Redev. Funding Entity Name: -
 Redevelopment Start Date: -
 Assessment Funding Entity: -
 Cleanup Funding Entity: Brownfields RLF Grant Funds Loaned
 Grant Type: Hazardous
 Accomplishment Type: -
 Accomplishment Count: -
 Cooperative Agreement Number: 96287213
 Start Date: -
 Ownership Entity: -
 Completion Date: -
 Current Owner: -
 Did Owner Change: -
 Cleanup Required: Y
 Video Available: -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1025442481 **DIST/DIR:** 0.236 NE **ELEVATION:** 29 **MAP ID:** 162

NAME: MILL BROOK TERRACE
ADDRESS: 570 E. 137TH STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 237104
ID/Status: -

SOURCE: US Environmental Protection Agency

Photo Available: -
Institutional Controls Required: U
IC Category Proprietary Controls: -
IC Cat. Info. Devices: -
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: -
State/tribal program date: -
State/tribal program ID: -
State/tribal NFA date: -
Air cleaned: -
Asbestos found: -
Asbestos cleaned: -
Controlled substance found: -
Controlled substance cleaned: -
Drinking water affected: -
Drinking water cleaned: -
Groundwater affected: Y
Groundwater cleaned: Y
Lead contaminant found: Y
Lead cleaned up: Y
No media affected: Not reported
Unknown media affected: -
Other cleaned up: -
Other metals found: Y
Other metals cleaned: Y
Other contaminants found: -
Other contams found description: -
PAHs found: -
PAHs cleaned up: -
PCBs found: -
PCBs cleaned up: -
Petro products found: -
Petro products cleaned: -
Sediments found: -
Sediments cleaned: -
Soil affected: Y
Soil cleaned up: Y
Surface water cleaned: -
VOCs found: -
VOCs cleaned: -
Cleanup other description: -
Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1025442481 **DIST/DIR:** 0.236 NE **ELEVATION:** 29 **MAP ID:** 162

NAME: MILL BROOK TERRACE
ADDRESS: 570 E. 137TH STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 237104
ID/Status: -

SOURCE: US Environmental Protection Agency

Past use residential acreage: -
Surface Water: -
Past use commercial acreage: -
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: -
Future use industrial acreage: -
Superfund Fed. landowner flag: -
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: Y
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: Y
Selenium cleaned up: -
SVOCs cleaned up: Y
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: Y
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: Y
Selenium contaminant found: -
SVOCs contaminant found: Y
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory Not reported
Property Description: -
Below Poverty Number: 14892
Below Poverty Percent: 43.23
Meidan Income: 9368
Meidan Income Number: 25191

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1025442481	DIST/DIR: 0.236 NE	ELEVATION: 29	MAP ID: 162

NAME: MILL BROOK TERRACE ADDRESS: 570 E. 137TH STREET BRONX, NY 10454	Rev: 06/10/2021 ID/Status: 237104 ID/Status: -

SOURCE: US Environmental Protection Agency

Meidan Income Percent: 73.12
 Vacant Housing Number: 1160
 Vacant Housing Percent: 9.56
 Unemployed Number: 2168
 Unemployed Percent: 6.29

Name: MILL BROOK TERRACE
 Address: 570 E. 137TH STREET
 City,State,Zip: BRONX, NY 10454
 Recipient Name: City of New York
 Grant Type: BCRLF
 Property Number: -
 Parcel size: .73
 Latitude: 40.8054877
 Longitude: -73.91793239999998
 HCM Label: -
 Map Scale: -
 Point of Reference: -
 Highlights: -
 Datum: -
 Acres Property ID: 237104
 IC Data Access: -
 Start Date: -
 Redev Completion Date: -
 Completed Date: -
 Acres Cleaned Up: -
 Cleanup Funding: -
 Cleanup Funding Source: -
 Assessment Funding: -
 Assessment Funding Source: -
 Redevelopment Funding: -
 Redev. Funding Source: -
 Redev. Funding Entity Name: -
 Redevelopment Start Date: -
 Assessment Funding Entity: -
 Cleanup Funding Entity: -
 Grant Type: Hazardous
 Accomplishment Type: -
 Accomplishment Count: -
 Cooperative Agreement Number: 96287213
 Start Date: -
 Ownership Entity: -
 Completion Date: -
 Current Owner: -
 Did Owner Change: -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1025442481 **DIST/DIR:** 0.236 NE **ELEVATION:** 29 **MAP ID:** 162

NAME: MILL BROOK TERRACE
ADDRESS: 570 E. 137TH STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 237104
ID/Status: -

SOURCE: US Environmental Protection Agency

Cleanup Required: Y
Video Available: -
Photo Available: -
Institutional Controls Required: U
IC Category Proprietary Controls: -
IC Cat. Info. Devices: -
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: -
State/tribal program date: -
State/tribal program ID: -
State/tribal NFA date: -
Air cleaned: -
Asbestos found: -
Asbestos cleaned: -
Controlled substance found: -
Controlled substance cleaned: -
Drinking water affected: -
Drinking water cleaned: -
Groundwater affected: Y
Groundwater cleaned: Y
Lead contaminant found: Y
Lead cleaned up: Y
No media affected: Not reported
Unknown media affected: -
Other cleaned up: -
Other metals found: Y
Other metals cleaned: Y
Other contaminants found: -
Other contams found description: -
PAHs found: -
PAHs cleaned up: -
PCBs found: -
PCBs cleaned up: -
Petro products found: -
Petro products cleaned: -
Sediments found: -
Sediments cleaned: -
Soil affected: Y
Soil cleaned up: Y
Surface water cleaned: -
VOCs found: -
VOCs cleaned: -
Cleanup other description: -

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1025442481	DIST/DIR: 0.236 NE	ELEVATION: 29	MAP ID: 162

NAME: MILL BROOK TERRACE
ADDRESS: 570 E. 137TH STREET
BRONX, NY 10454

Rev: 06/10/2021
ID/Status: 237104
ID/Status: -

SOURCE: US Environmental Protection Agency

Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -
Past use residential acreage: -
Surface Water: -
Past use commercial acreage: -
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: -
Future use industrial acreage: -
Superfund Fed. landowner flag: -
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: Y
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: Y
Selenium cleaned up: -
SVOCs cleaned up: Y
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: Y
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: Y
Selenium contaminant found: -
SVOCs contaminant found: Y
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory Not reported
Property Description: -
Below Poverty Number: 14892
Below Poverty Percent: 43.23

- Continued on next page -

Site Detail Report

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

US BROWNFIELDS

EDR ID: 1025442481 **DIST/DIR:** 0.236 NE **ELEVATION:** 29 **MAP ID:** 162

NAME: MILL BROOK TERRACE

Rev: 06/10/2021

ADDRESS: 570 E. 137TH STREET
BRONX, NY 10454

ID/Status: 237104
ID/Status: -

SOURCE: US Environmental Protection Agency

Meidan Income: 9368
Meidan Income Number: 25191
Meidan Income Percent: 73.12
Vacant Housing Number: 1160
Vacant Housing Percent: 9.56
Unemployed Number: 2168
Unemployed Percent: 6.29

Database Descriptions

NPL: NPL National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices. NPL - National Priority List Proposed NPL - Proposed National Priority List Sites.

NPL Delisted: Delisted NPL The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate. Delisted NPL - National Priority List Deletions

CERCLIS: SEMS SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly know as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL. SEMS - Superfund Enterprise Management System

NFRAP: SEMS-ARCHIVE SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be potential NPL site. SEMS-ARCHIVE - Superfund Enterprise Management System Archive

RCRA COR ACT: CORRACTS CORRACTS identifies hazardous waste handlers with RCRA corrective action activity. CORRACTS - Corrective Action Report

RCRA TSD: RCRA-TSDF RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste. RCRA-TSDF - RCRA - Treatment, Storage and Disposal

RCRA GEN: RCRA-LQG RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. RCRA-LQG - RCRA - Large Quantity Generators RCRA-SQG - RCRA - Small Quantity Generators. RCRA-VSQG - RCRA - Very Small Quantity Generators (Formerly Conditionally Exempt Small Quantity Generators).

Federal IC / EC: US ENG CONTROLS A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health. US ENG CONTROLS - Engineering Controls Sites List US INST CONTROLS - Institutional Controls Sites List.

Database Descriptions

ERNS: ERNS Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances. ERNS - Emergency Response Notification System

State/Tribal CERCLIS: SHWS Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites SHWS - Inactive Hazardous Waste Disposal Sites in New York State

State/Tribal SWL: SWF/LF Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites. SWF/LF - Facility Register

State/Tribal LTANKS: INDIAN LUST R1 INDIAN LUST R9 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R8 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R5 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R4 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R7 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R10 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R6 - Leaking Underground Storage Tanks on Indian Land. LUSTs on Indian land in Arizona, California, New Mexico and Nevada INDIAN LUST R6 - Leaking Underground Storage Tanks on Indian Land LTANKS - Spills Information Database. HIST LTANKS - Listing of Leaking Storage Tanks.

State/Tribal Tanks: UST Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. UST - Petroleum Bulk Storage (PBS) Database CBS UST - Chemical Bulk Storage Database. MOSF UST - Major Oil Storage Facilities Database. CBS - Chemical Bulk Storage Site Listing. MOSF - Major Oil Storage Facility Site Listing. AST - Petroleum Bulk Storage. CBS AST - Chemical Bulk Storage Database. MOSF AST - Major Oil Storage Facilities Database. INDIAN UST R4 - Underground Storage Tanks on Indian Land. INDIAN UST R6 - Underground Storage Tanks on Indian Land. INDIAN UST R1 - Underground Storage Tanks on Indian Land. INDIAN UST R10 - Underground Storage Tanks on Indian Land. INDIAN UST R5 - Underground Storage Tanks on Indian Land. INDIAN UST R9 - Underground Storage Tanks on Indian Land. INDIAN UST R8 - Underground Storage Tanks on Indian Land. INDIAN UST R7 - Underground Storage Tanks on Indian Land. TANKS - Storage Tank Facility Listing. TANKS NASSAU - Registered Tank Database in Nassau County.

State/Tribal IC / EC: ENV RES DECL RES DECL - Restrictive Declarations Listing. A restrictive declaration is a covenant running with the land which binds the present and future owners of the property. As a condition of certain special permits, the City Planning Commission may require an applicant to sign and record a restrictive declaration that places specified conditions on the future use and development of the property. Certain restrictive declarations are indicated by a D on zoning maps. RES DECL - Restrictive Declarations Listing ENG CONTROLS - Registry of Engineering Controls. INST CONTROL - Registry of Institutional Controls.

State/Tribal VCP: VCP NYC VCP - Voluntary Cleanup Agreements. New York established its Voluntary Cleanup Program (VCP) to address the environmental, legal and financial barriers that often hinder the redevelopment and reuse of contaminated properties. The Voluntary Cleanup Program was developed to enhance private sector cleanup of brownfields by enabling parties to remediate sites using private rather than public funds and to reduce the development pressures on "greenfield" sites. VCP - Voluntary Cleanup Agreements

ST/Tribal Brownfields: BROWNFIELDS A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant. BROWNFIELDS - Brownfields Site List ERP - Environmental Restoration Program Listing.

US Brownfields: US BROWNFIELDS Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs. US BROWNFIELDS - A Listing of Brownfields Sites

Database Descriptions

Other Haz Sites: US CDL A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments. US CDL - Clandestine Drug Labs PFAS - PFAS Contamination Site Location Listing.

Other Tanks: TANKS SUFFOLK This county is not included in the state's database. These are facilities that have no tank information in the storage tank database. TANKS SUFFOLK - Storage Tank Database CORTLAND CO. UST - Cortland County Storage Tank Listing. WESTCHESTER CO. UST - Listing of Storage Tanks. NASSAU CO. UST - Registered Tank Database. ROCKLAND CO. UST - Petroleum Bulk Storage Database. SUFFOLK CO. UST - Storage Tank Database. NCFM UST - Storage Tank Database. HIST UST - Historical Petroleum Bulk Storage Database. CORTLAND CO. AST - Cortland County Storage Tank Listing. WESTCHESTER CO. AST - Listing of Storage Tanks. NASSAU CO. AST - Registered Tank Database. ROCKLAND CO. AST - Petroleum Bulk Storage Database. SUFFOLK CO. AST - Storage Tank Database. NCFM AST - Storage Tank Database. HIST AST - Historical Petroleum Bulk Storage Database.

Spills: HMIRS Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT. HMIRS - Hazardous Materials Information Reporting System SPILLS - Spills Information Database. HIST SPILLS - SPILLS Database. SPILLS 90 - SPILLS90 data from FirstSearch. SPILLS 80 - SPILLS80 data from FirstSearch.

Other: RCRA NonGen / NLR RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste. RCRA NonGen / NLR - RCRA - Non Generators / No Longer Regulated FEDLAND - Federal and Indian Lands. TSCA - Toxic Substances Control Act. TRIS - Toxic Chemical Release Inventory System. SSTS - Section 7 Tracking Systems. RAATS - RCRA Administrative Action Tracking System. PRP - Potentially Responsible Parties. PADS - PCB Activity Database System. ICIS - Integrated Compliance Information System. FTTS - FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act). FTTS INSP - FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act). MLTS - Material Licensing Tracking System. RADINFO - Radiation Information Database. BRS - Biennial Reporting System. INDIAN RESERV - Indian Reservations. US AIRS (AFS) - Aerometric Information Retrieval System Facility Subsystem (AFS). US AIRS MINOR - Air Facility System Data. FINDS - Facility Index System/Facility Registry System. DRYCLEANERS - Registered Drycleaners. HSWDS - Hazardous Substance Waste Disposal Site Inventory. NY MANIFEST - Facility and Manifest Data. SPDES - State Pollutant Discharge Elimination System. COOLING TOWERS - Registered Cooling Towers. PCS INACTIVE - Listing of Inactive PCS Permits. PCS ENF - Enforcement data. PCS - Permit Compliance System. MINES MRDS - Mineral Resources Data System.

Database Sources

NPL: EPA

Updated Quarterly

NPL Delisted: EPA

Updated Quarterly

CERCLIS: EPA

Updated Quarterly

NFRAP: EPA

Updated Quarterly

RCRA COR ACT: EPA

Updated Quarterly

RCRA TSD: Environmental Protection Agency

Updated Quarterly

RCRA GEN: Environmental Protection Agency

Updated Quarterly

Federal IC / EC: Environmental Protection Agency

Varies

ERNS: National Response Center, United States Coast Guard

Updated Quarterly

State/Tribal CERCLIS: Department of Environmental Conservation

Updated Annually

State/Tribal SWL: Department of Environmental Conservation

Updated Quarterly

State/Tribal LTANKS: EPA Region 1

Varies

State/Tribal Tanks: Department of Environmental Conservation

No Update Planned

Database Sources

State/Tribal IC / EC: NYC Department of City Planning

Varies

State/Tribal VCP: New York City Office of Environmental Protection

Varies

ST/Tribal Brownfields: Department of Environmental Conservation

Updated Semi-Annually

US Brownfields: Environmental Protection Agency

Updated Semi-Annually

Other Haz Sites: Drug Enforcement Administration

Updated Quarterly

Other Tanks: Department of Health Services

Varies

Spills: U.S. Department of Transportation

Updated Quarterly

Other: Environmental Protection Agency

Updated Quarterly

Street Name Report for Streets near the Target Property

Target Property: 517-521 EAST 132ND STREET
BRONX, NY 10454

JOB: NA

Street Name	Dist/Dir	Street Name	Dist/Dir
Brook Ave	0.03 WNW		
Brown Pl	0.08 WNW		
Bruckner Blvd	0.04 NNE		
Cypress Pl	0.17 ESE		
E 132nd St	0.02 SSW		
E 133rd St	0.13 ESE		
E 134th St	0.09 NNE		
E 135th St	0.14 NNE		
E 136th St	0.19 NNE		
E 137th St	0.24 NNE		
I-87 N	0.12 NNE		
I-87 S	0.11 NNE		
Ramp	0.16 East		
Saint Anns Ave	0.08 ESE		
Saint Anns Pl	0.13 ESE		
Willis Ave	0.24 NW		


Environmental FirstSearch

0.25 Mile Radius

ASTM MAP: NPL, RCRACOR, STATES Sites



517-521 EAST 132ND STREET BRONX, NY 10454

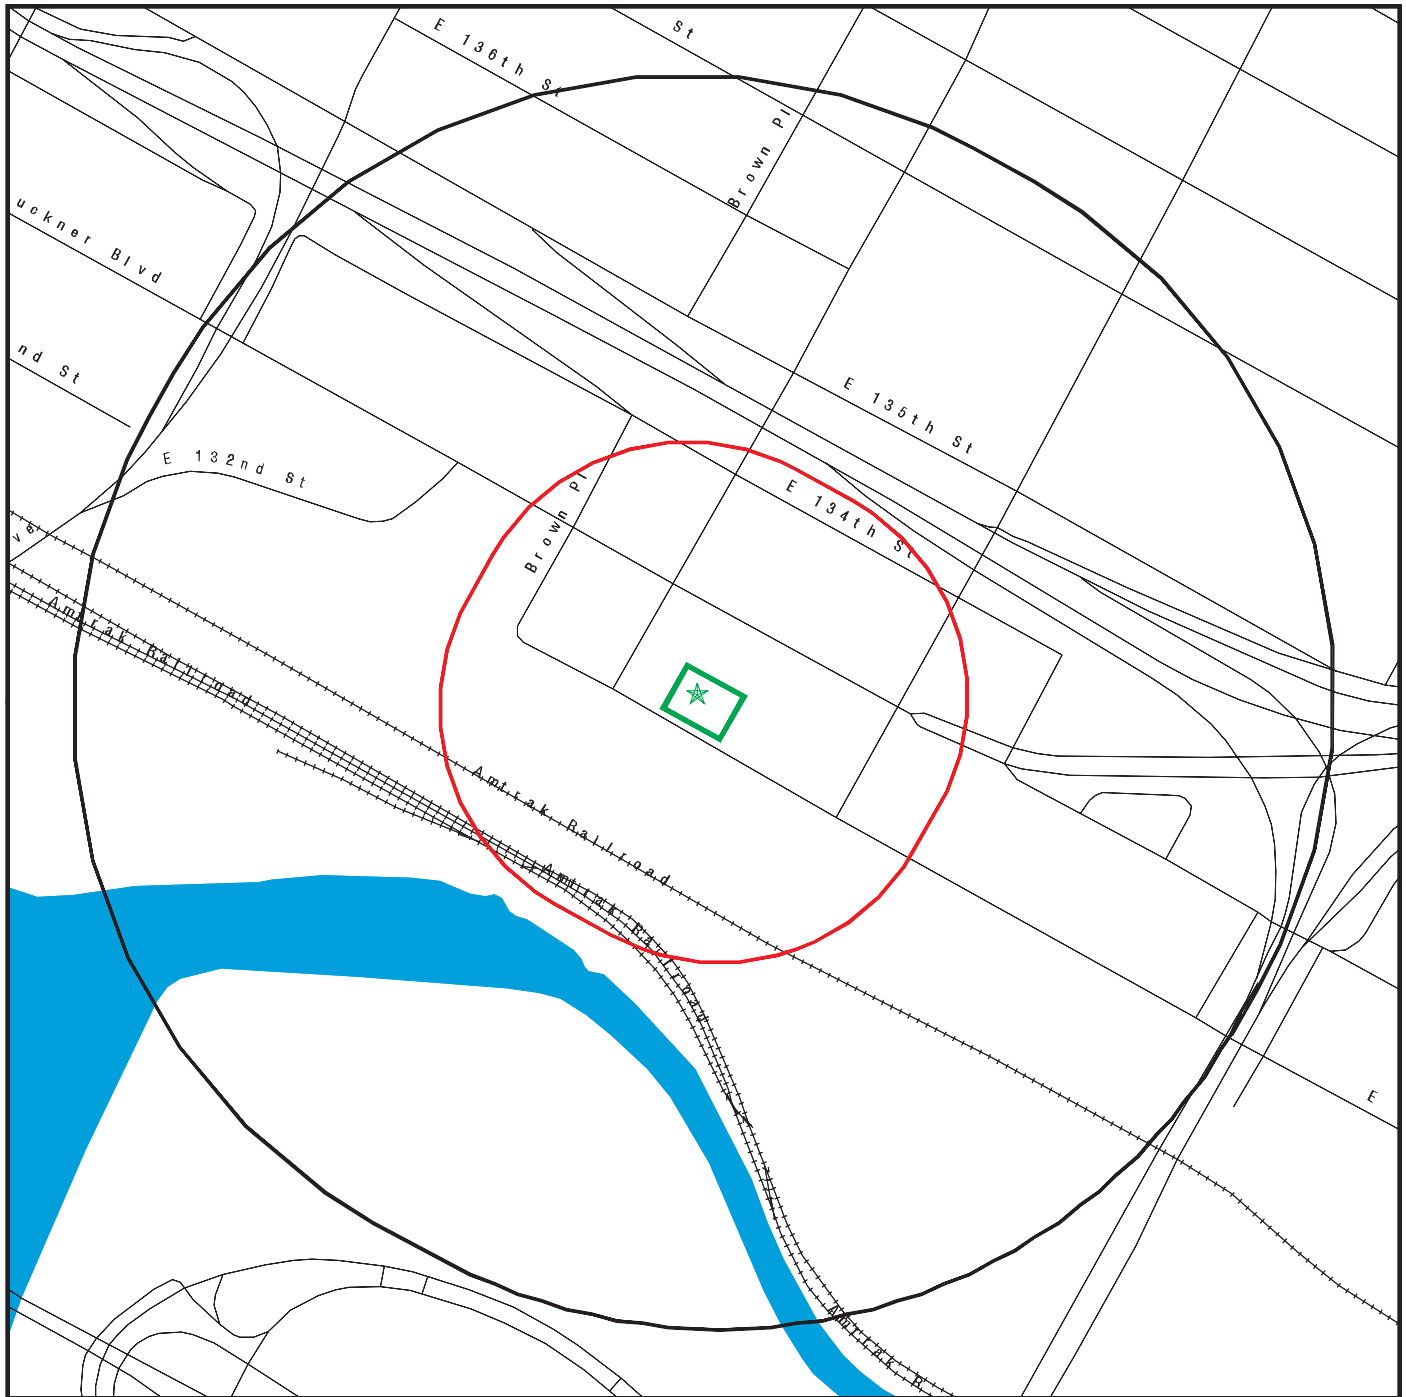

Black Rings Represent Qtr. Mile Radius; Red Ring Represents 500 ft. Radius

- ★ Target Property (Latitude: 40.803656 Longitude: 73.921395)
- ▲ Identified Sites
- Indian Reservations BIA
- National Priority List Sites


Environmental FirstSearch

0.25 Mile Radius

ASTM MAP: CERCLIS, RCRATSD, LUST, SWL




517-521 EAST 132ND STREET BRONX, NY 10454

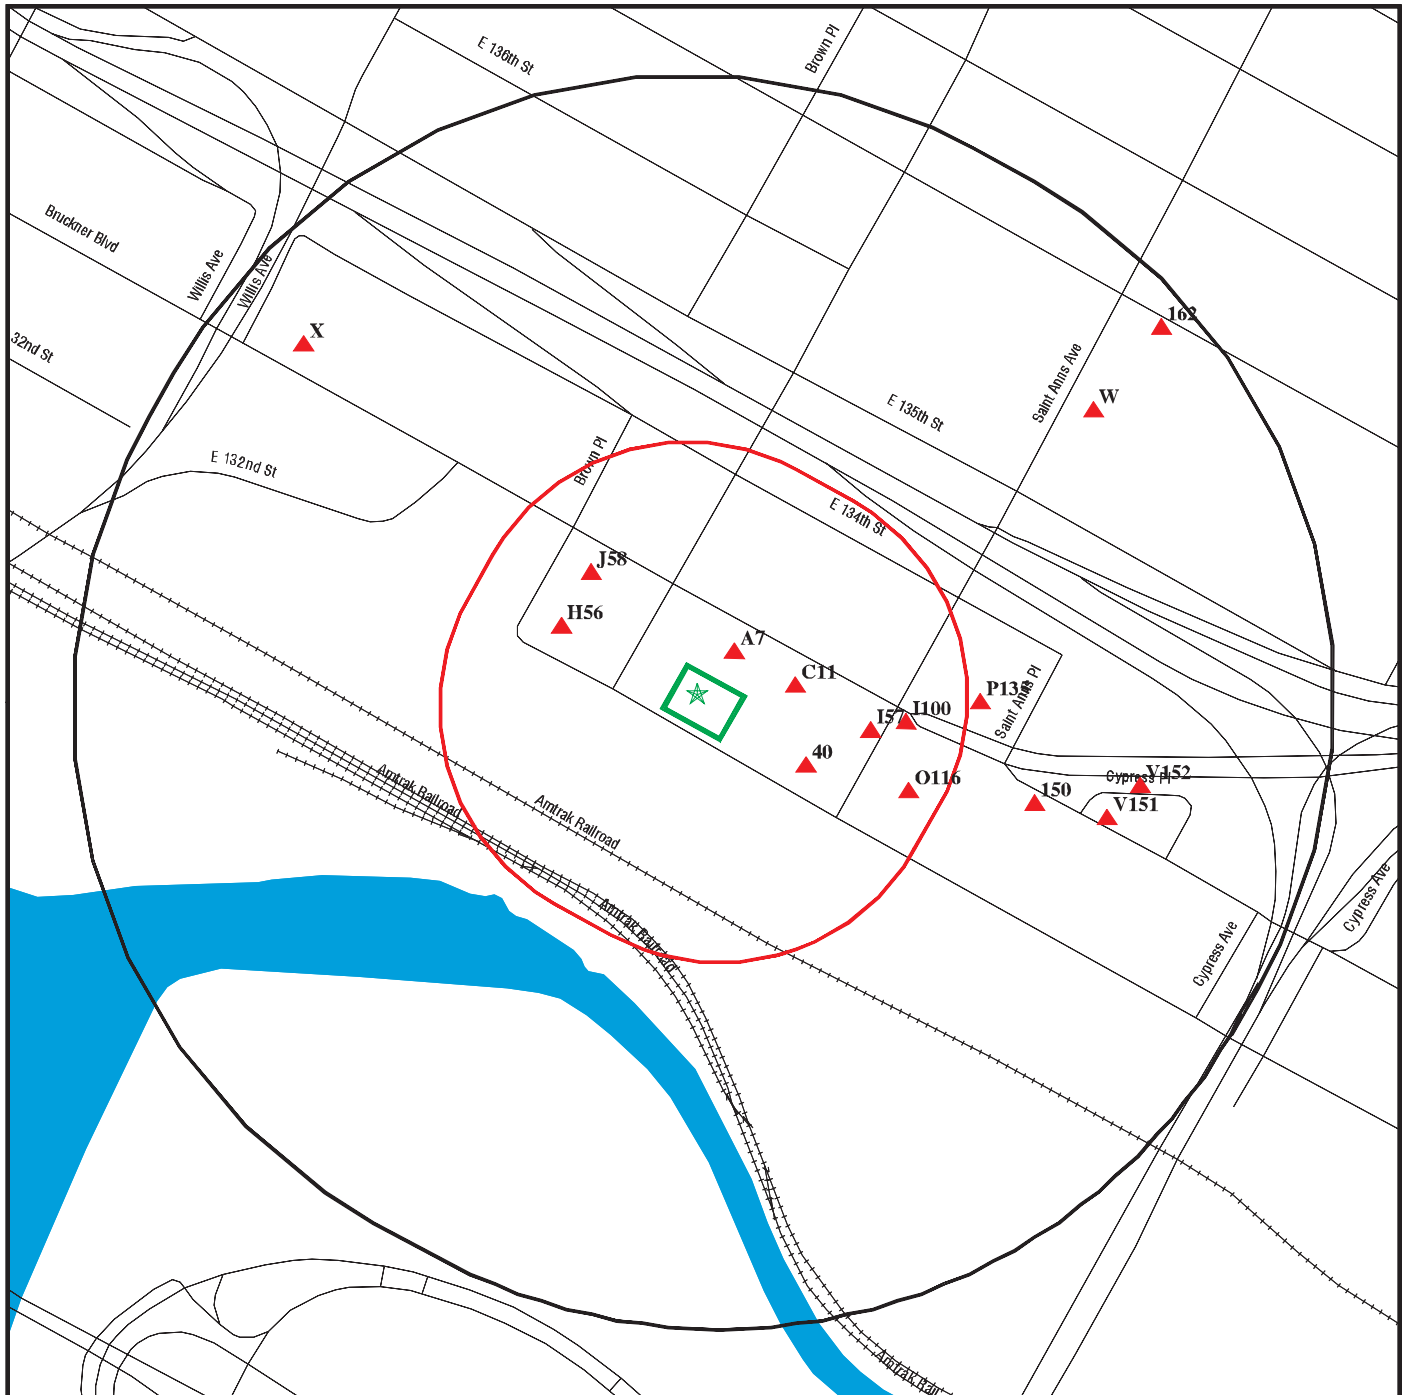

Black Rings Represent Qtr. Mile Radius; Red Ring Represents 500 ft. Radius

- ★ Target Property (Latitude: 40.803656 Longitude: 73.921395)
- ▲ Identified Sites
- Indian Reservations BIA
- National Priority List Sites

517-521 EAST 132ND STREET BRONX, NY 10454

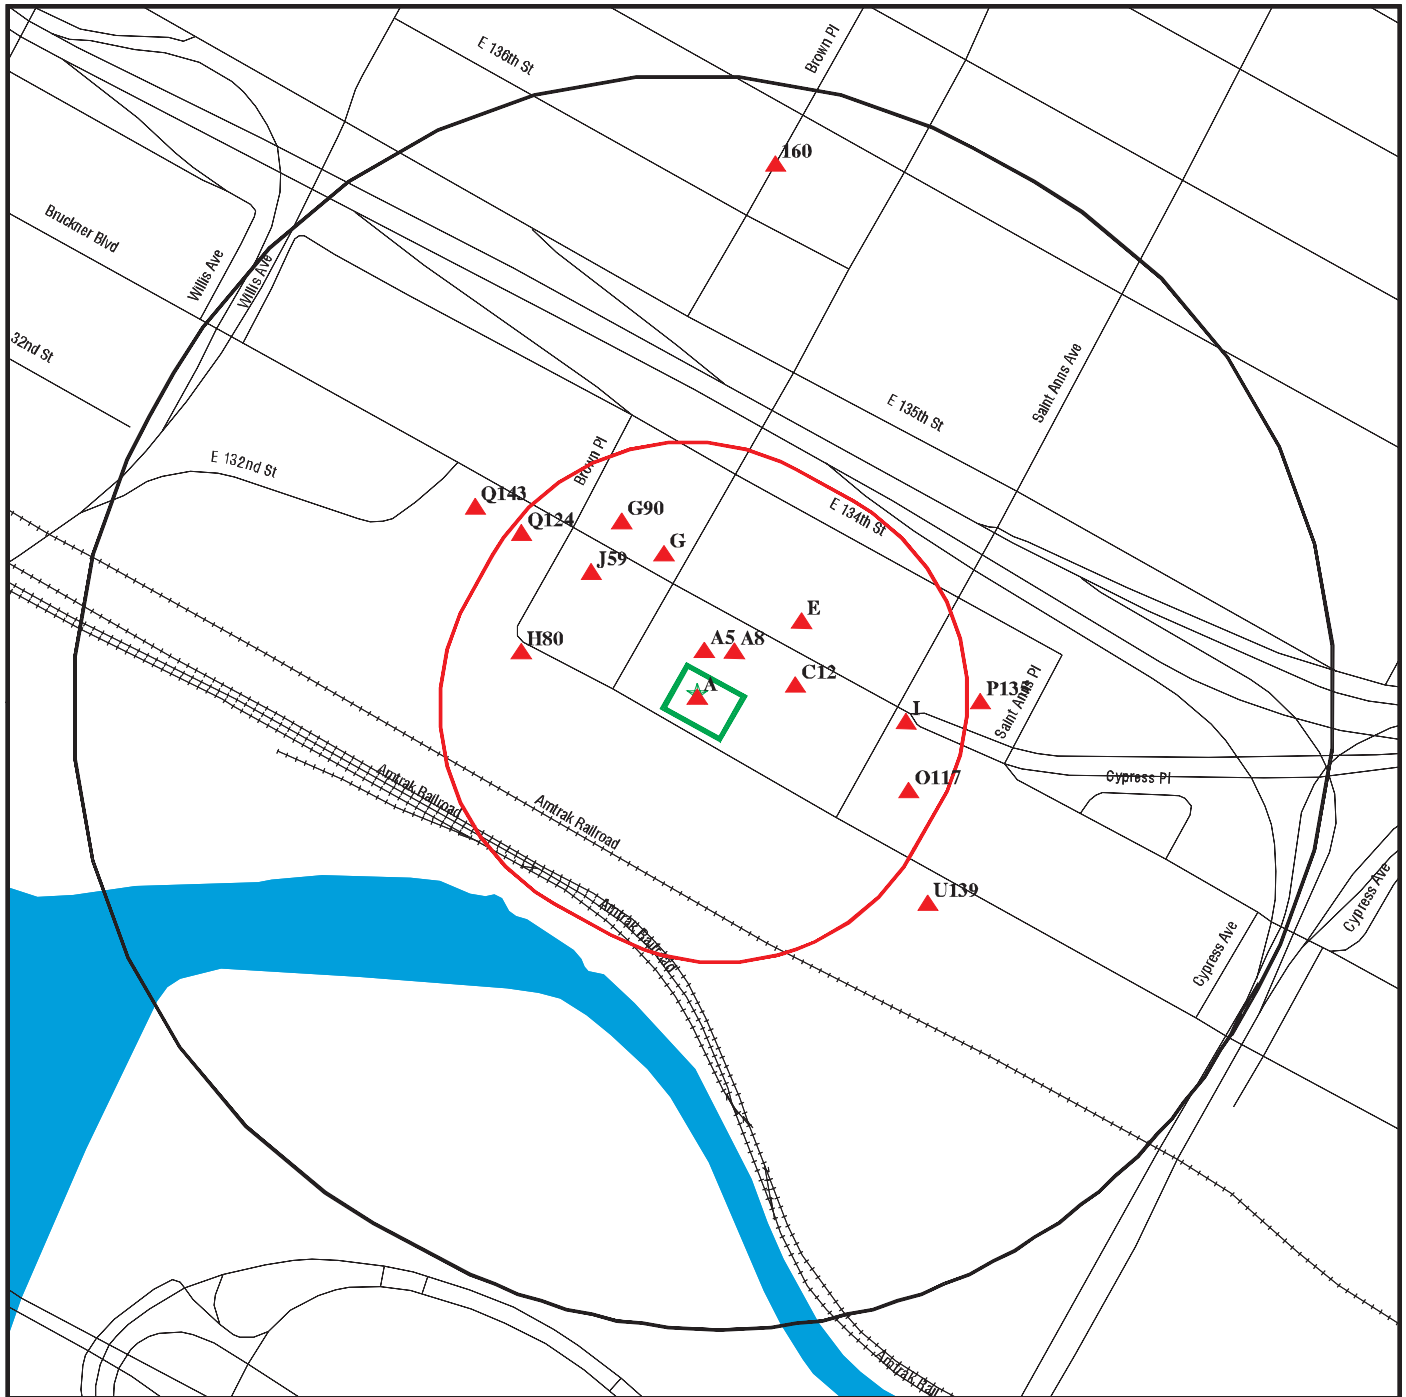

Black Rings Represent Qtr. Mile Radius; Red Ring Represents 500 ft. Radius

- ★ Target Property (Latitude: 40.803656 Longitude: 73.921395)
- ▲ Identified Sites
- Indian Reservations BIA
- National Priority List Sites

0.25 Mile Radius
Non ASTM Map, Spills, FINDS

